




GFSK_DH5_HOPP_Ant1_NTNV

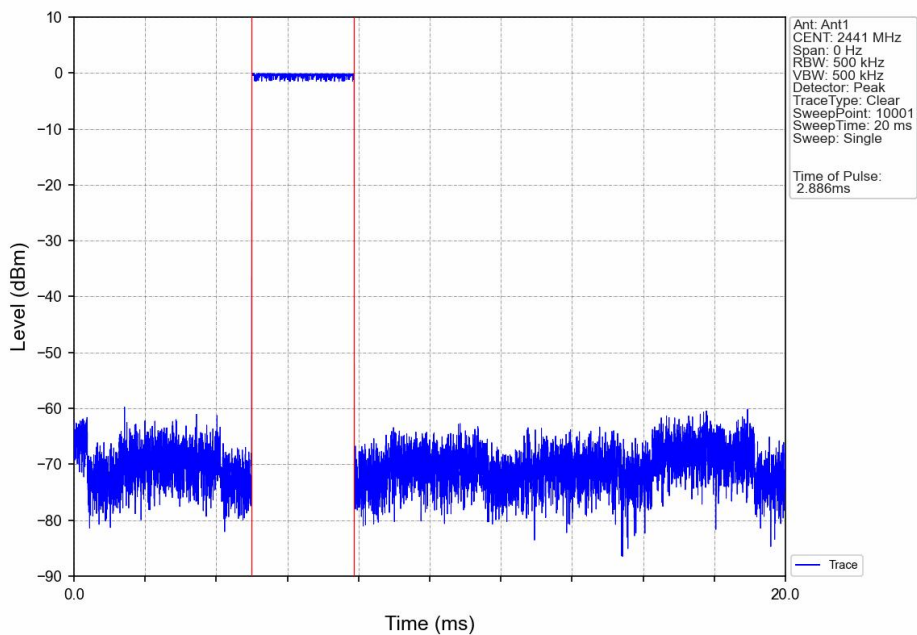


GFSK_DH5_HOPP_Ant1_NTNV

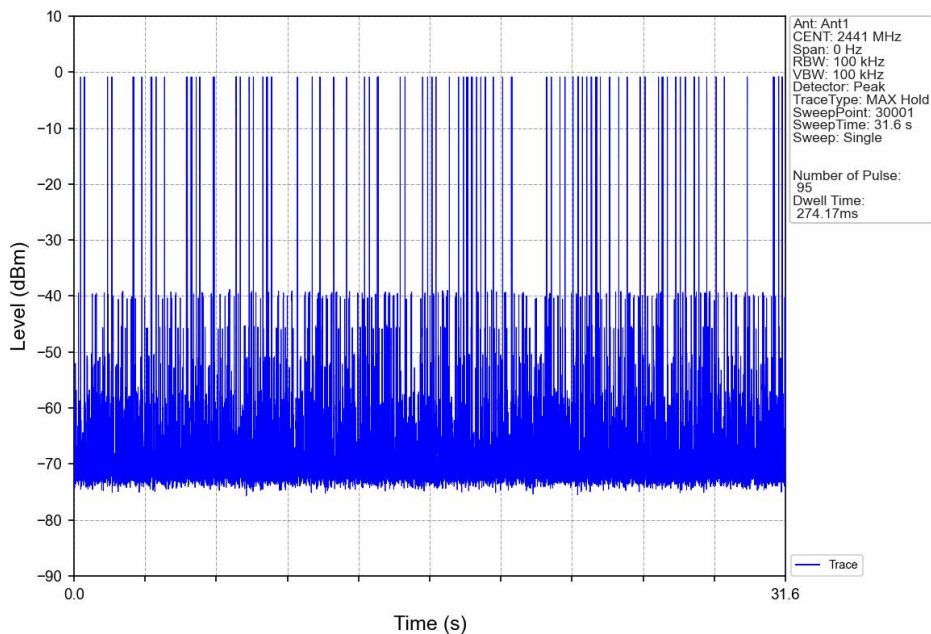


Pi/4DQPSK_2DH1_HOPP_Ant1_NTNV

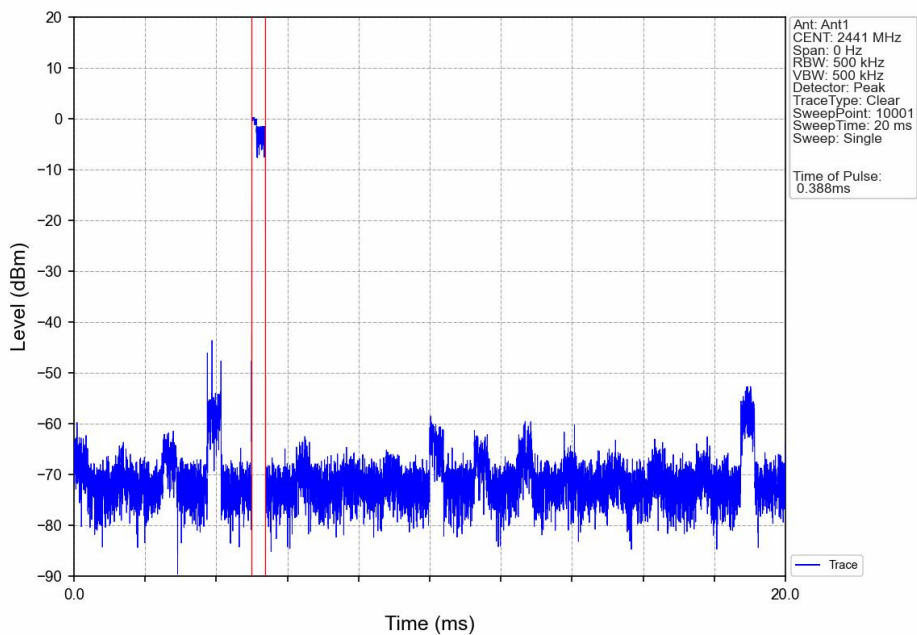


Pi/4DQPSK_2DH1_HOPP_Ant1_NTNV

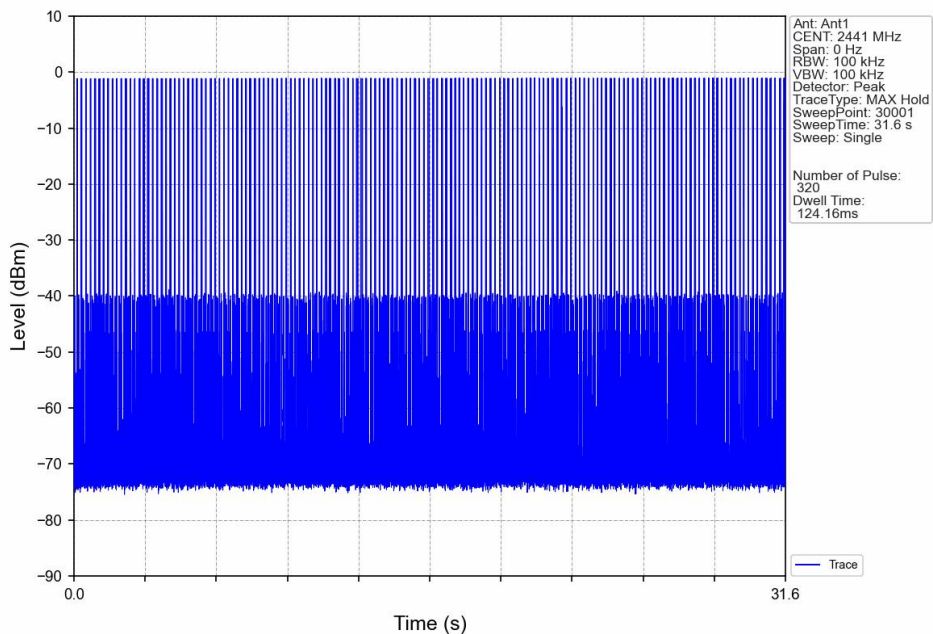


Pi/4DQPSK_2DH3_HOPP_Ant1_NTNV

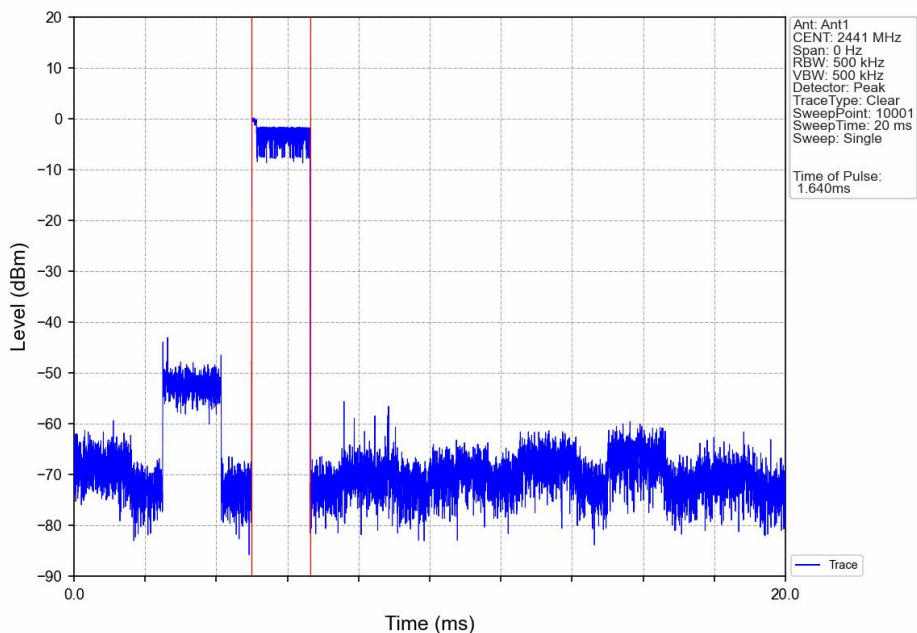


Pi/4DQPSK_2DH3_HOPP_Ant1_NTNV


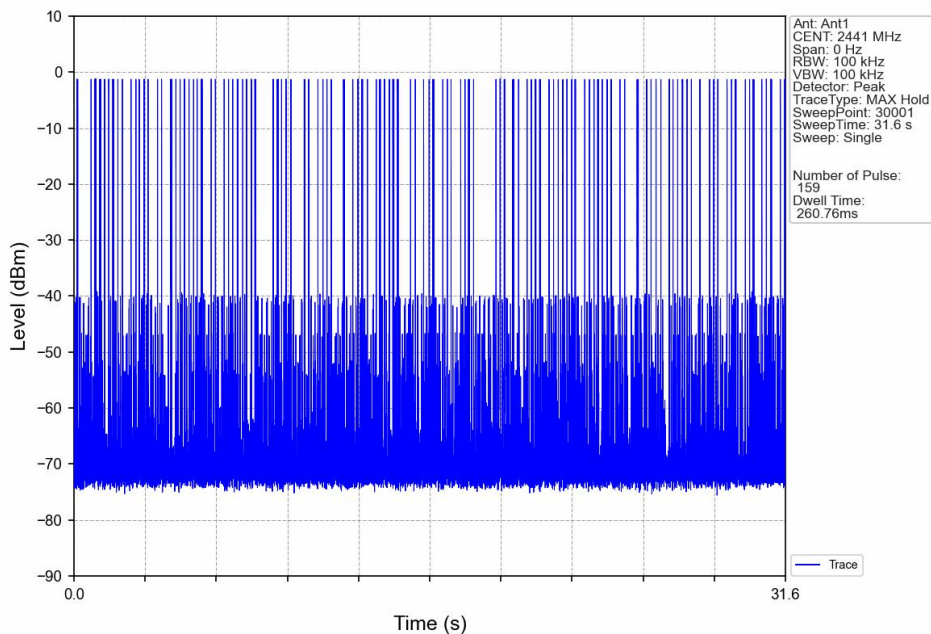


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

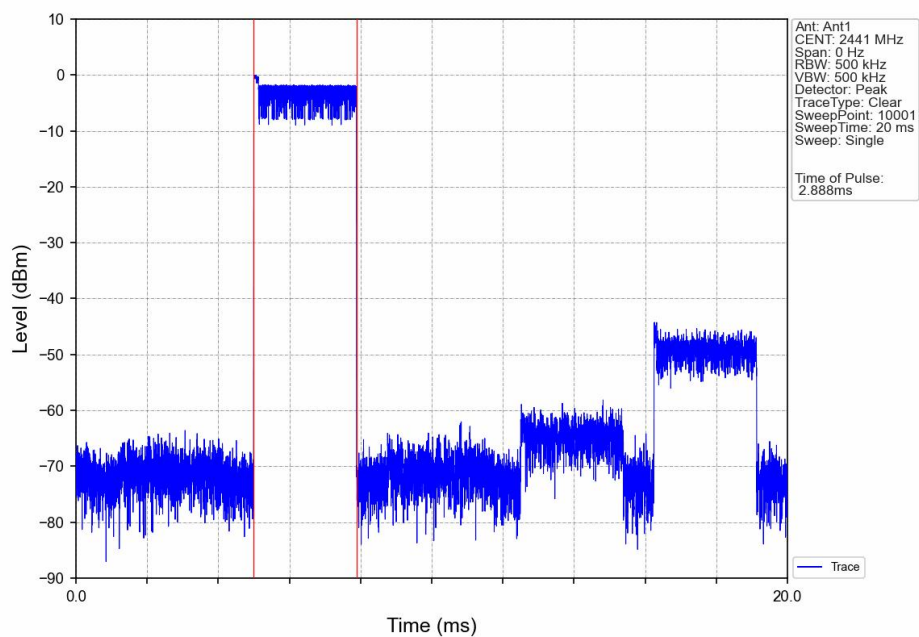


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

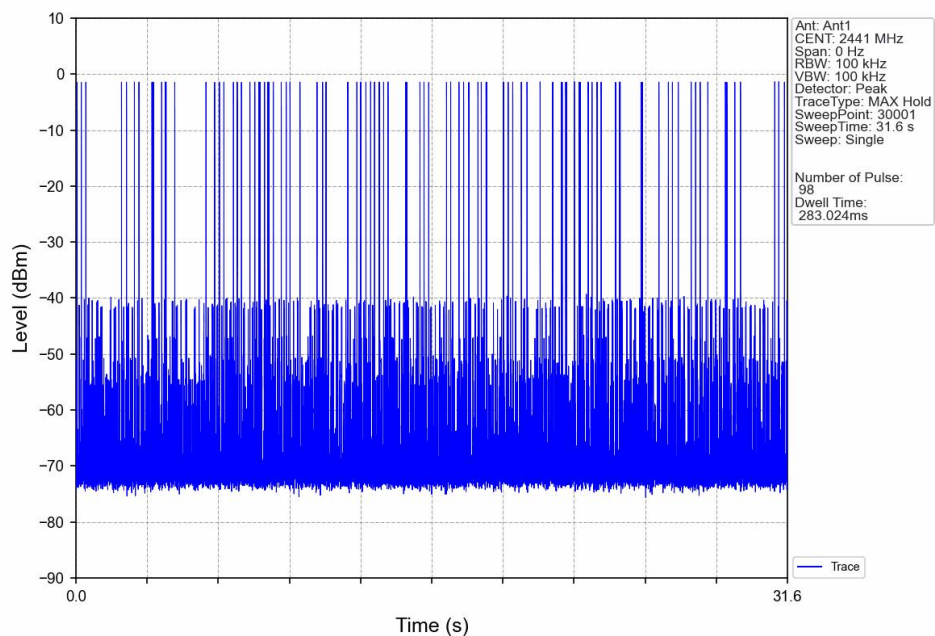


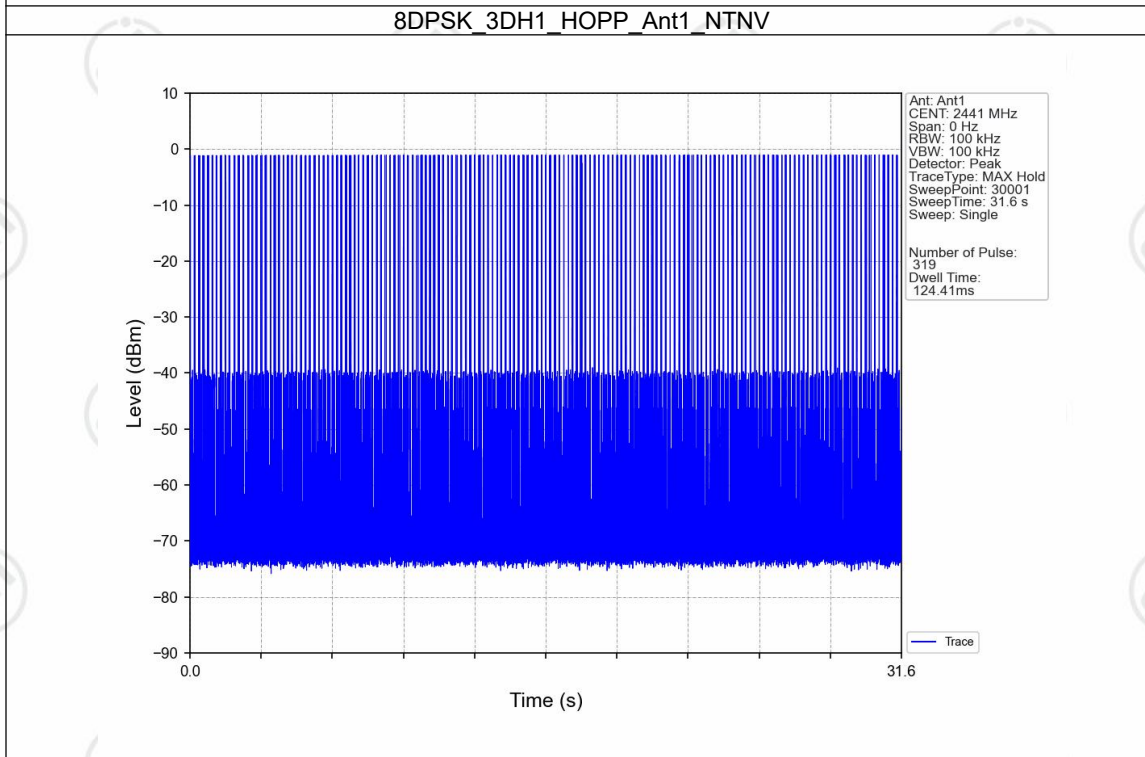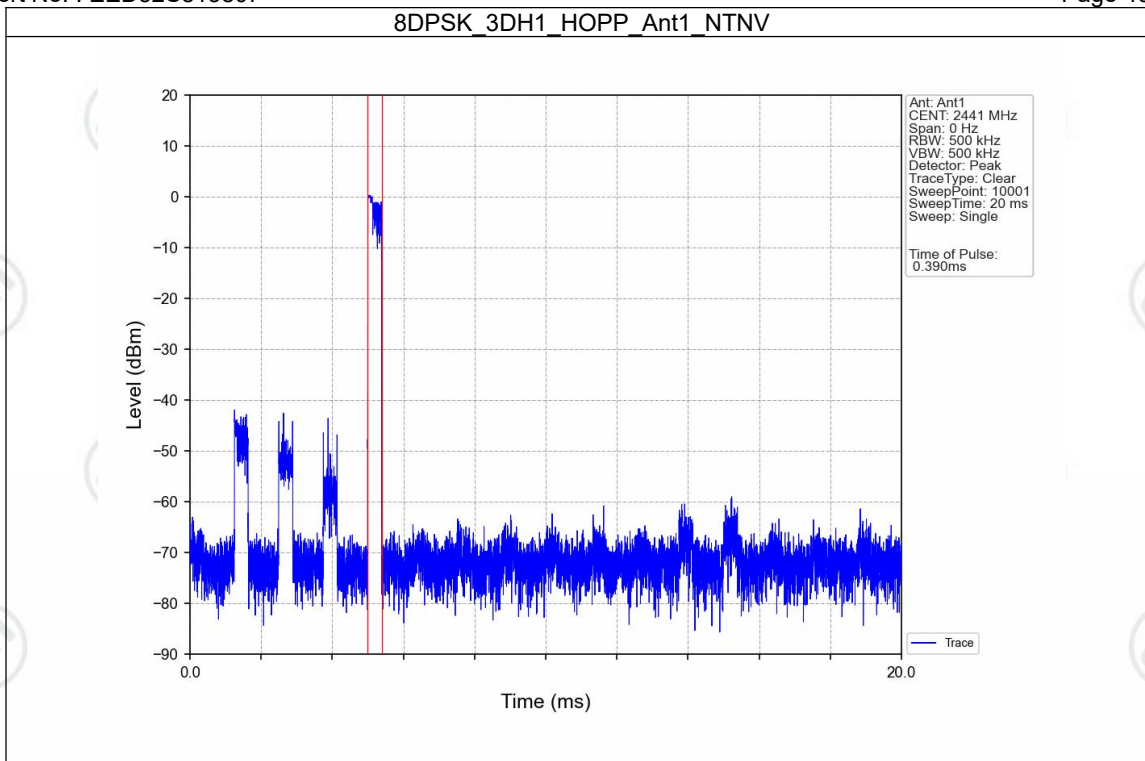


8DPSK_3DH3_HOPP_Ant1_NTNV

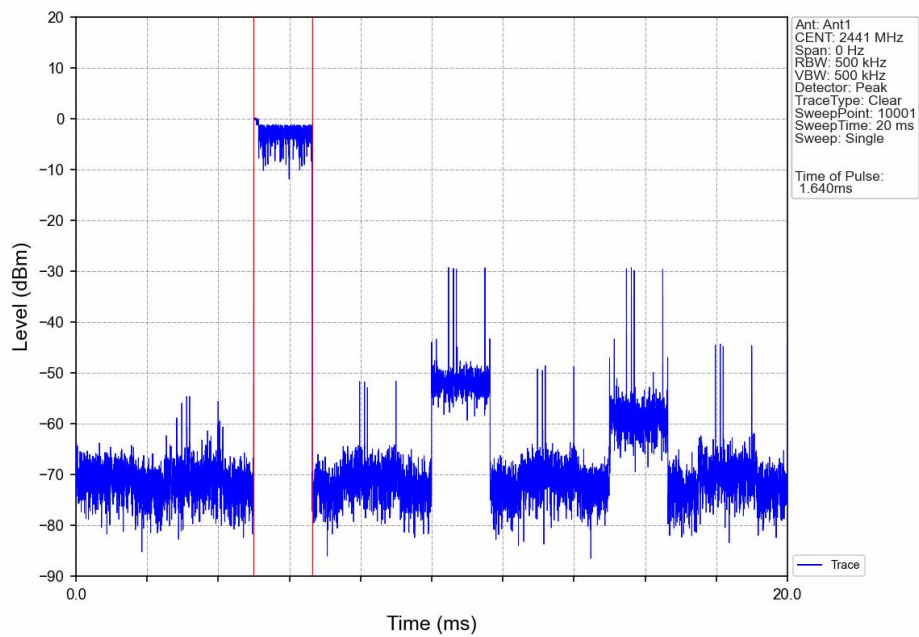


8DPSK_3DH3_HOPP_Ant1_NTNV

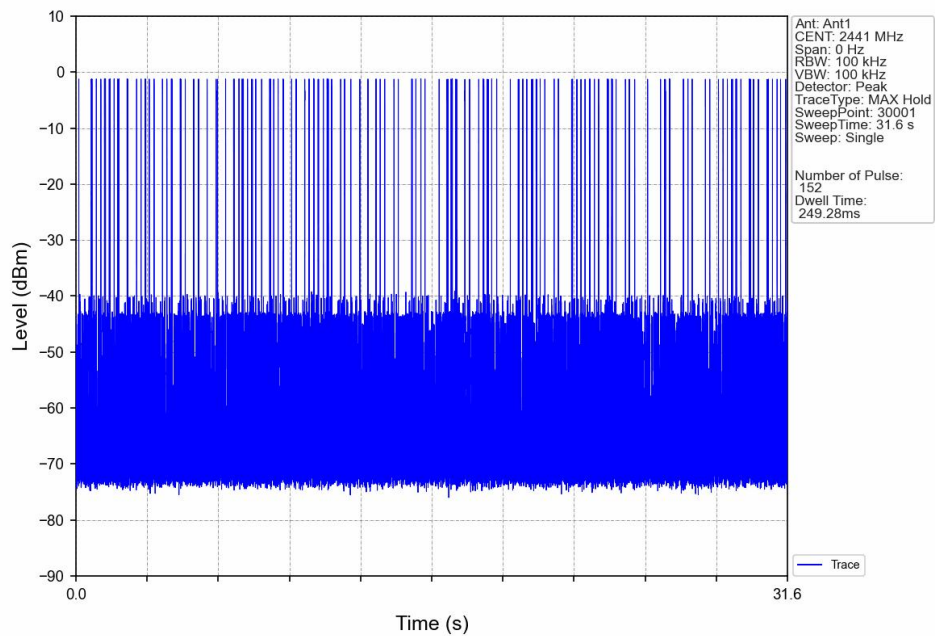

8DPSK_3DH5_HOPP_Ant1_NTNV

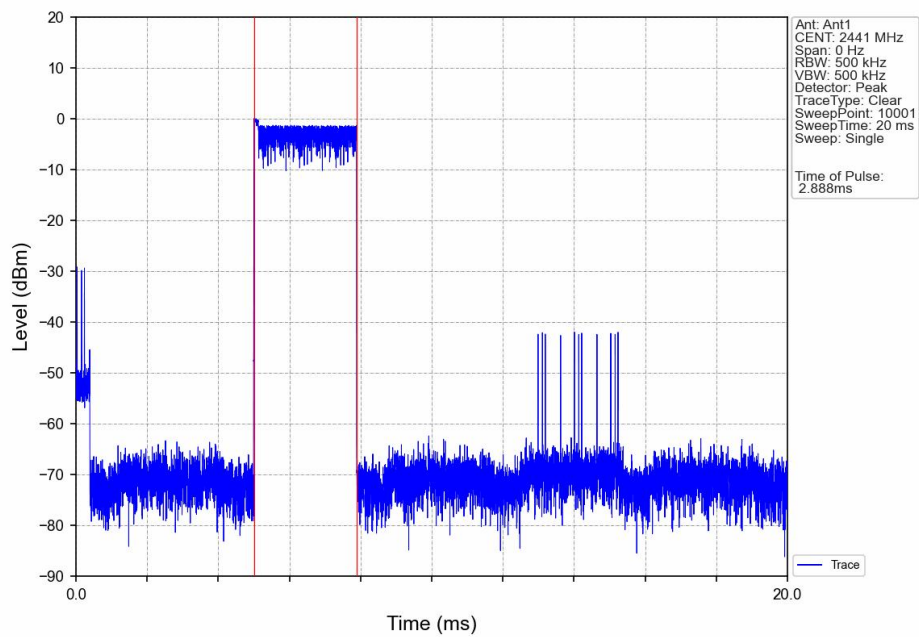

8DPSK_3DH5_HOPP_Ant1_NTNV

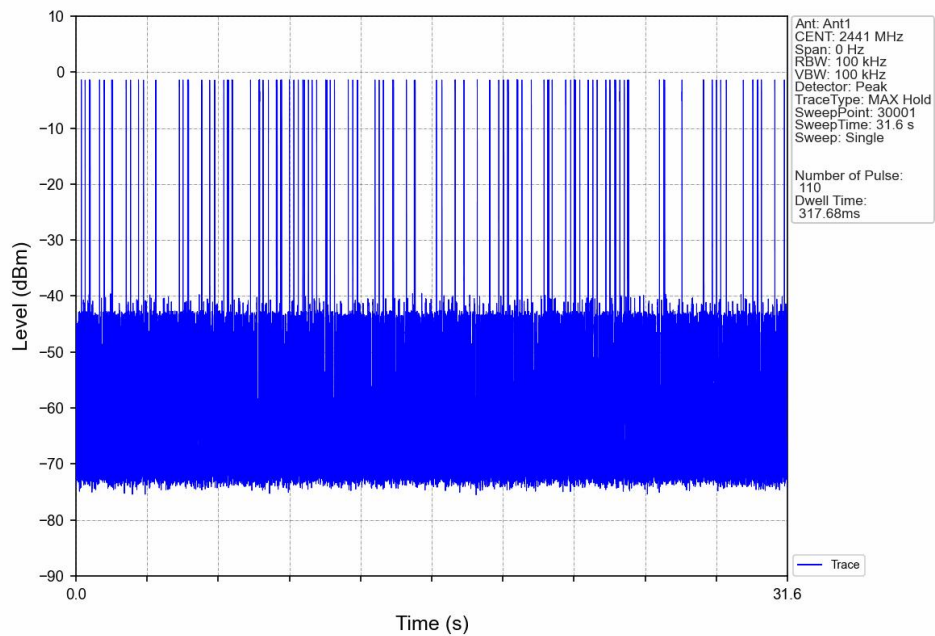

7. Unwanted Emissions In Non-restricted Frequency Bands

7.1 Test Result

7.1.1 Ref


Mode	TX Type	Frequency (MHz)	Packet Type	ANT	Level of Reference (dBm)
GFSK	SISO	2402	DH5	1	0.07
		2441	DH5	1	0.03
		2480	DH5	1	-0.08
Pi/4DQPSK	SISO	2402	2DH5	1	0.17
		2441	2DH5	1	0.07
		2480	2DH5	1	-0.04
8DPSK	SISO	2402	3DH5	1	0.14
		2441	3DH5	1	0.07
		2480	3DH5	1	-0.03

7.1.2 CSE


Mode	TX Type	Frequency (MHz)	Packet Type	ANT	Level of Reference (dBm)	Limit (dBm)	Verdict
GFSK	SISO	2402	DH5	1	0.07	-19.93	Pass
		2441	DH5	1	0.07	-19.93	Pass
		2480	DH5	1	0.07	-19.93	Pass
		HOPP	DH5	1	0.07	-19.93	Pass
					0.07	-19.93	Pass
Pi/4DQPSK	SISO	2402	2DH5	1	0.17	-19.83	Pass
		2441	2DH5	1	0.17	-19.83	Pass
		2480	2DH5	1	0.17	-19.83	Pass
		HOPP	2DH5	1	0.17	-19.83	Pass
					0.17	-19.83	Pass
8DPSK	SISO	2402	3DH5	1	0.14	-19.86	Pass
		2441	3DH5	1	0.14	-19.86	Pass
		2480	3DH5	1	0.14	-19.86	Pass
		HOPP	3DH5	1	0.14	-19.86	Pass
					0.14	-19.86	Pass

7.2 Test Graph


7.2.1 Ref

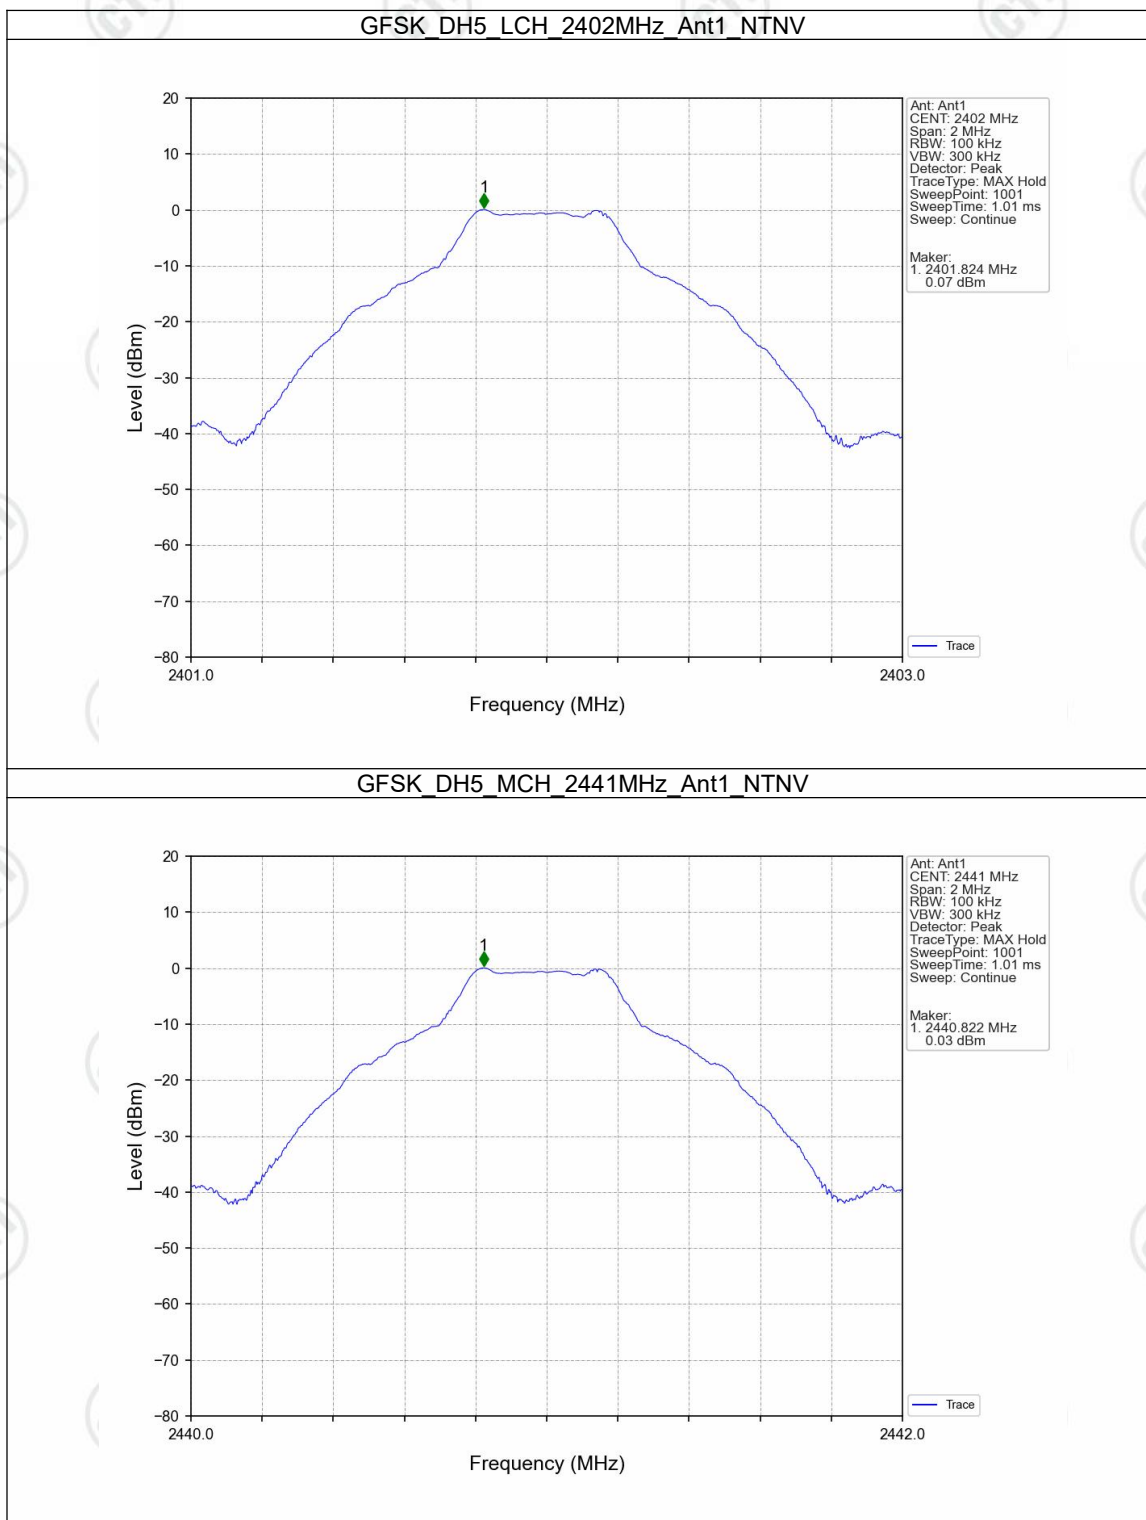


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

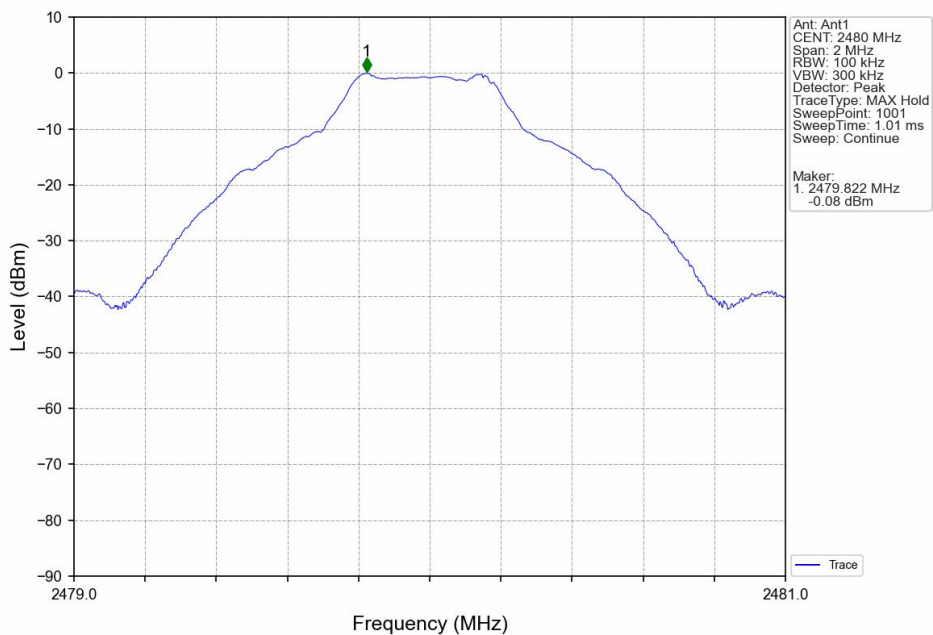


Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

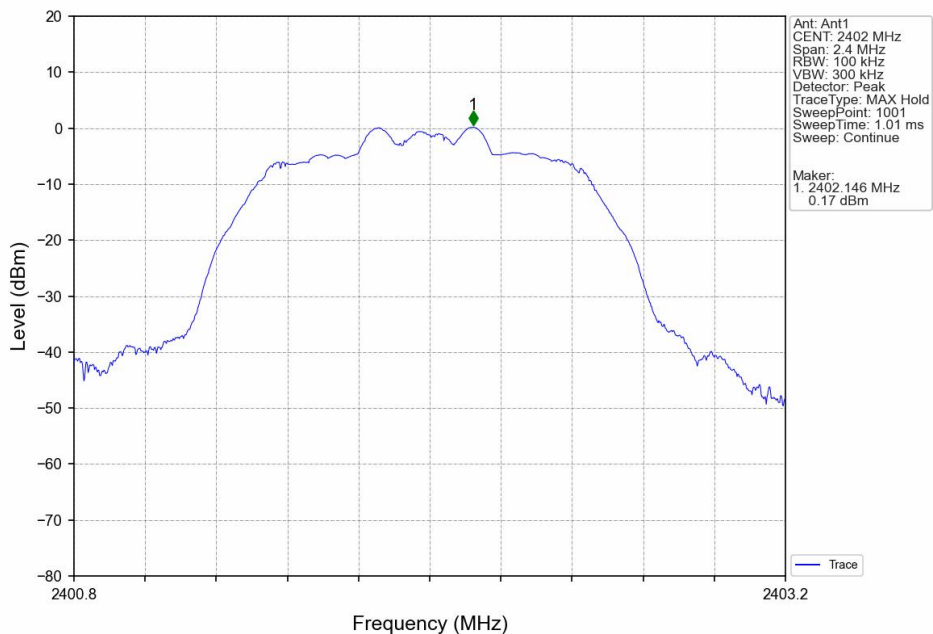


Pi/4DQPSK_2DH5_MCH_2441MHz_Ant1_NTNV

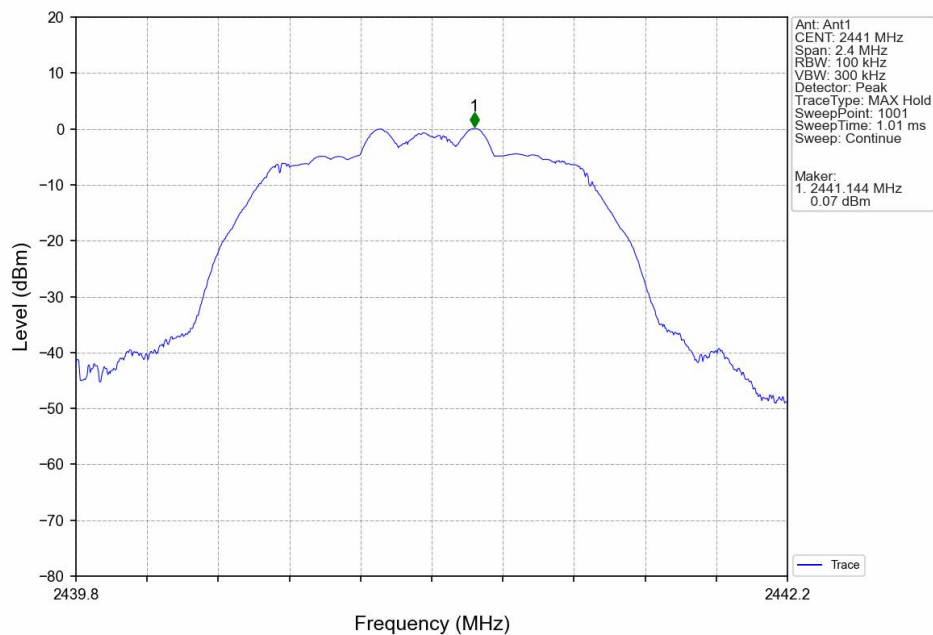


Pi/4DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

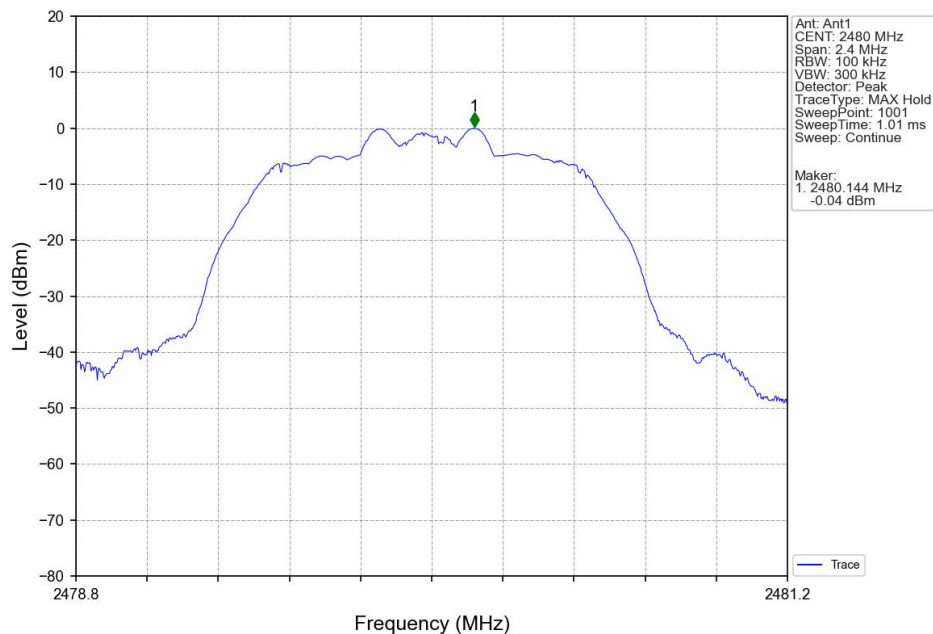


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

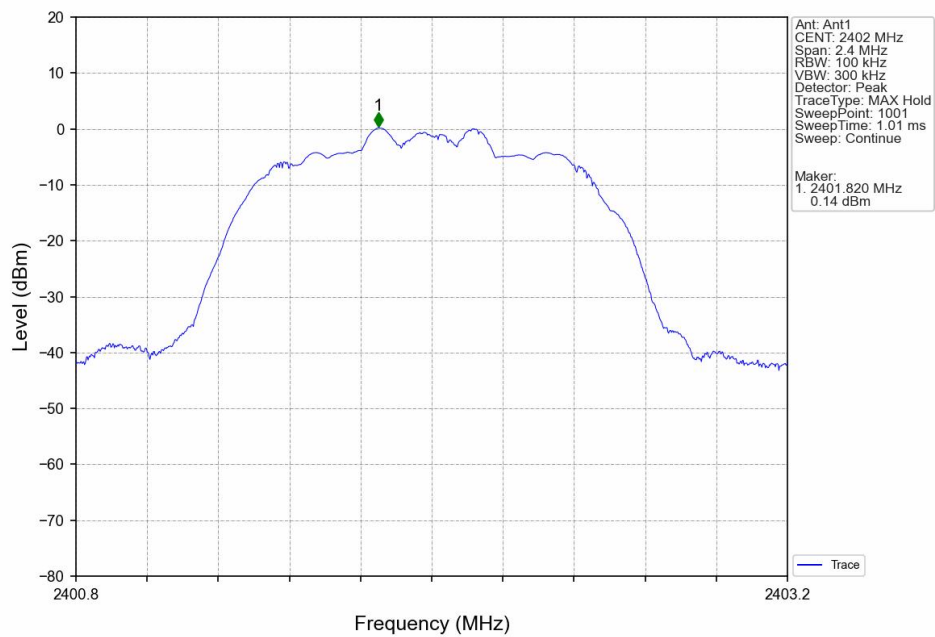


8DPSK_3DH5_MCH_2441MHz_Ant1_NTNV

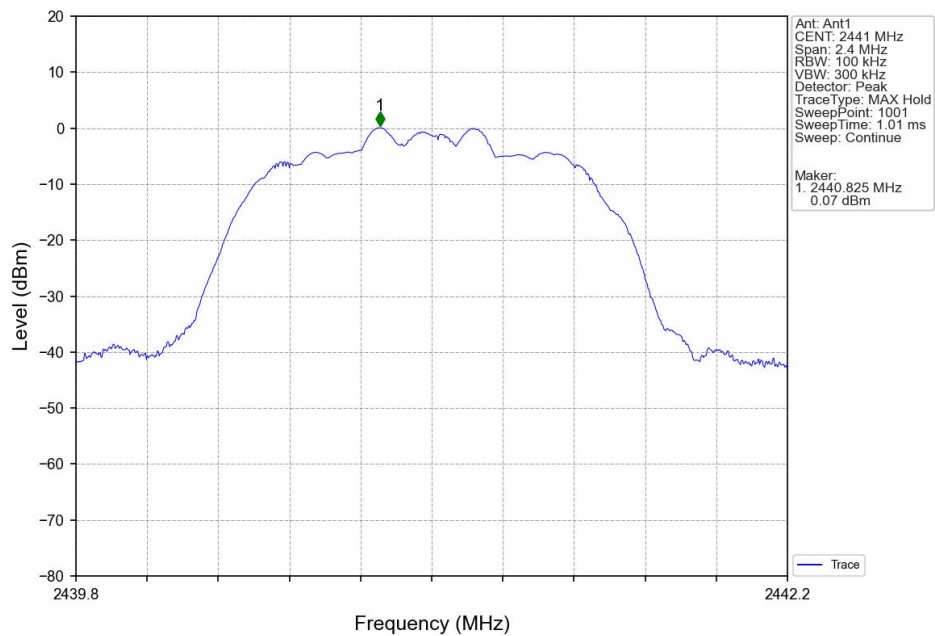


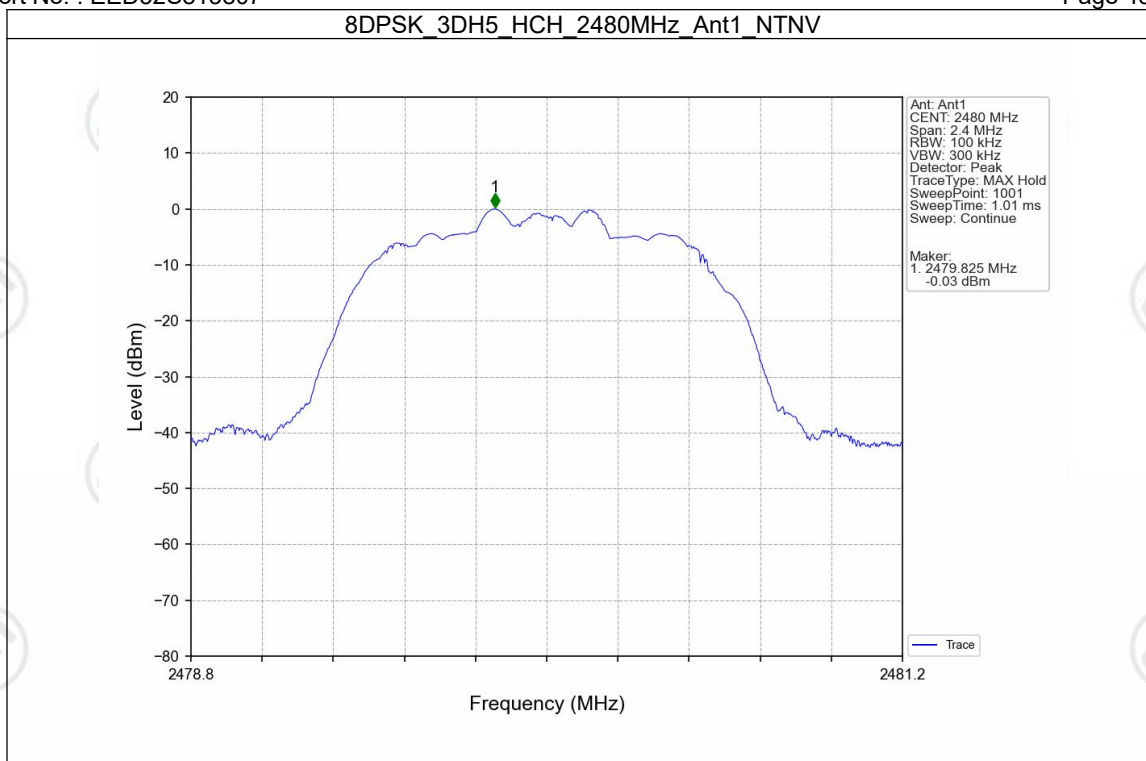


7.2.2 CSE

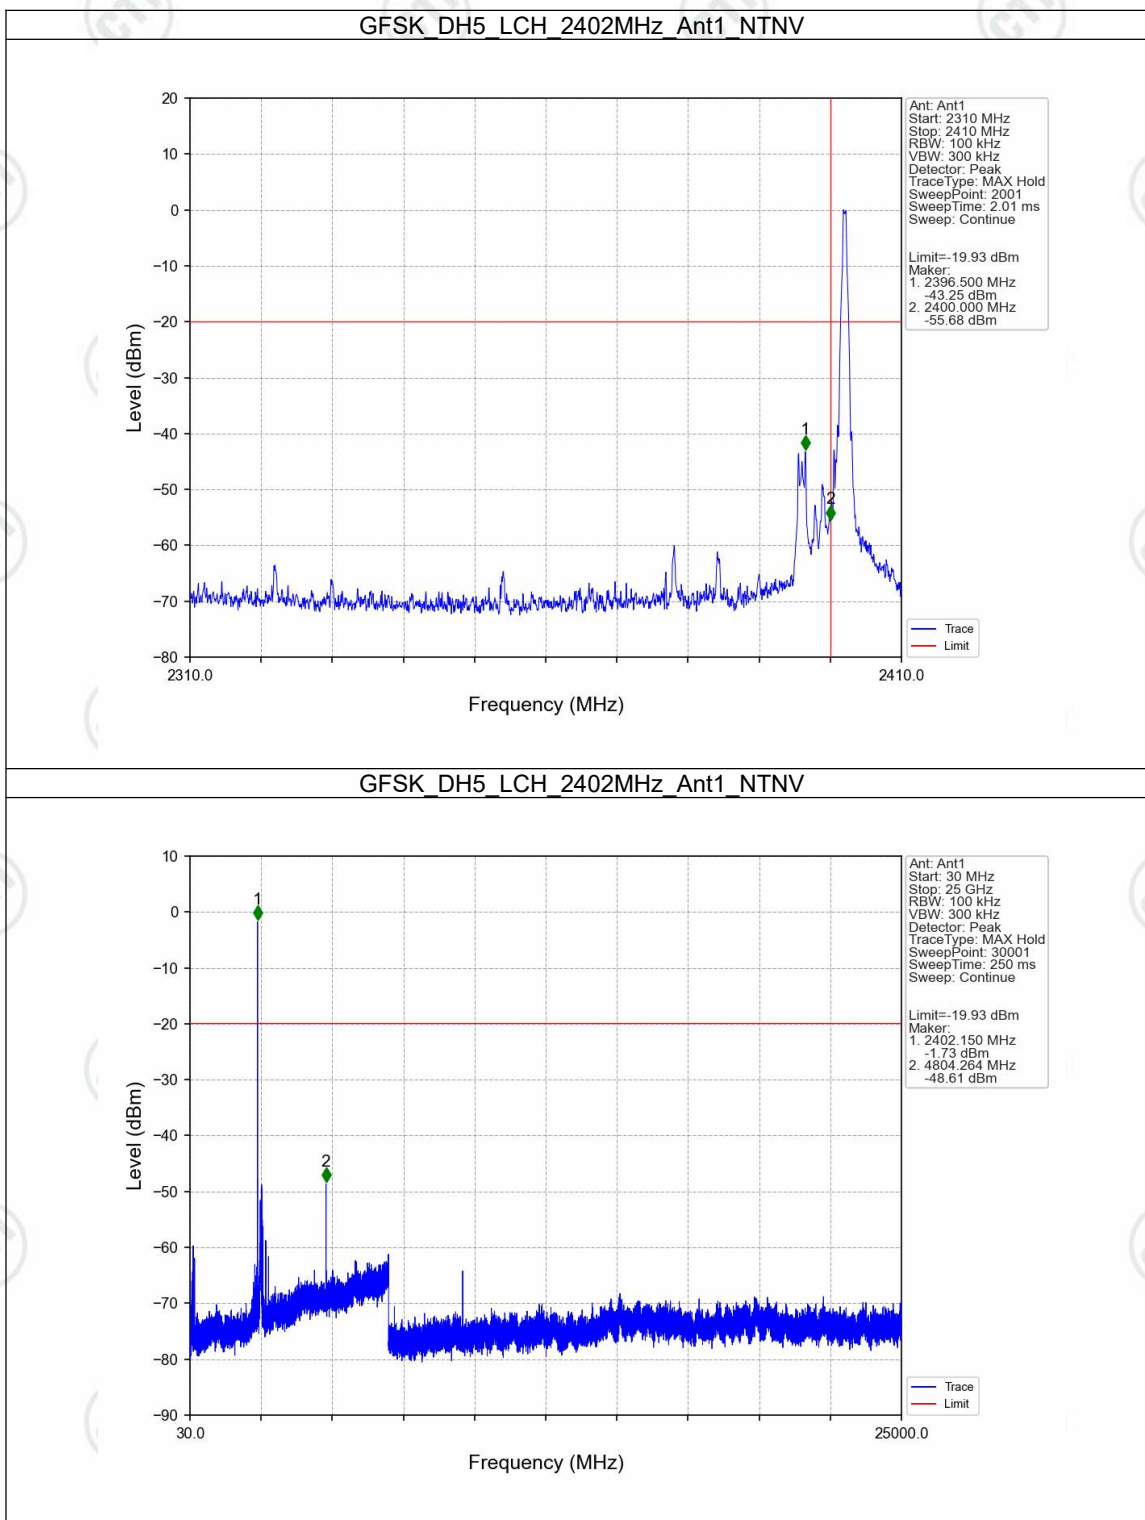


GFSK_DH5_MCH_2441MHz_Ant1_NTNV

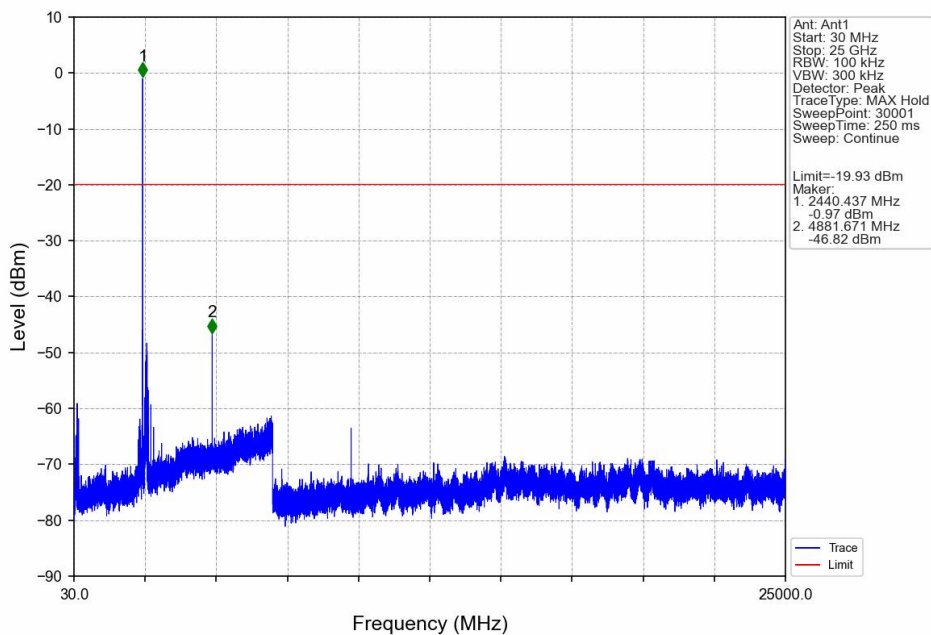


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

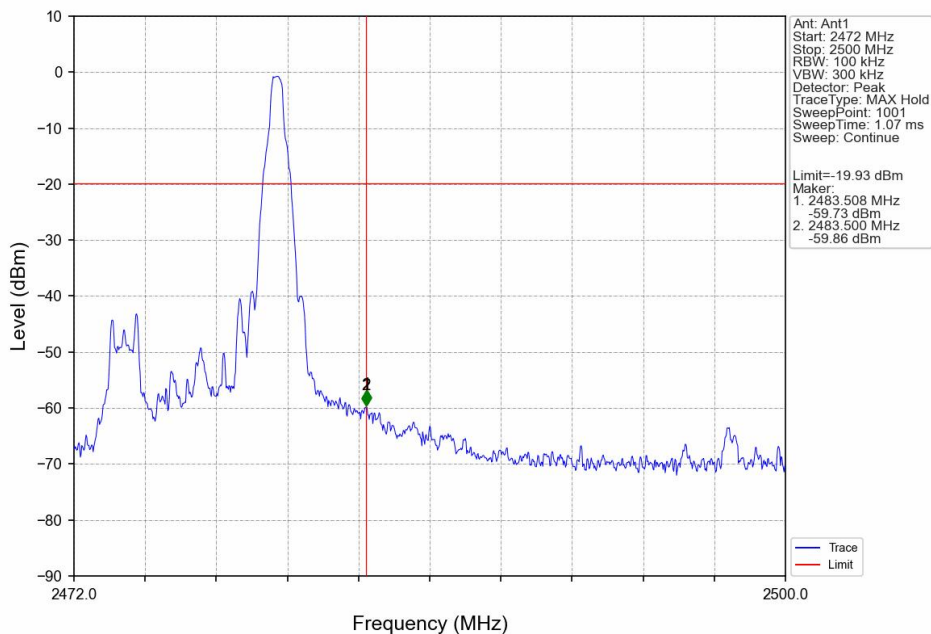


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

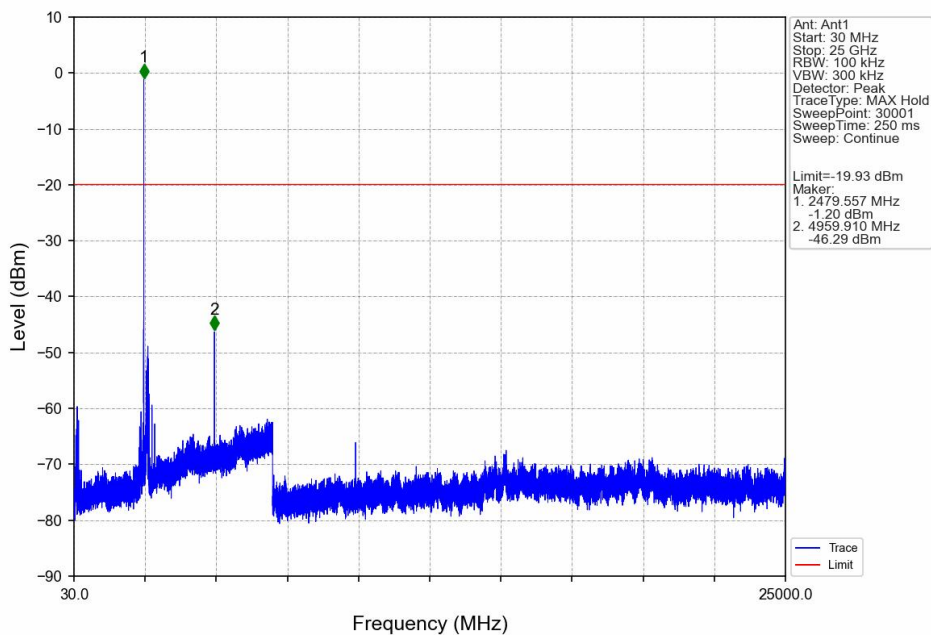


GFSK_DH5_HOPP_Ant1_NTNV

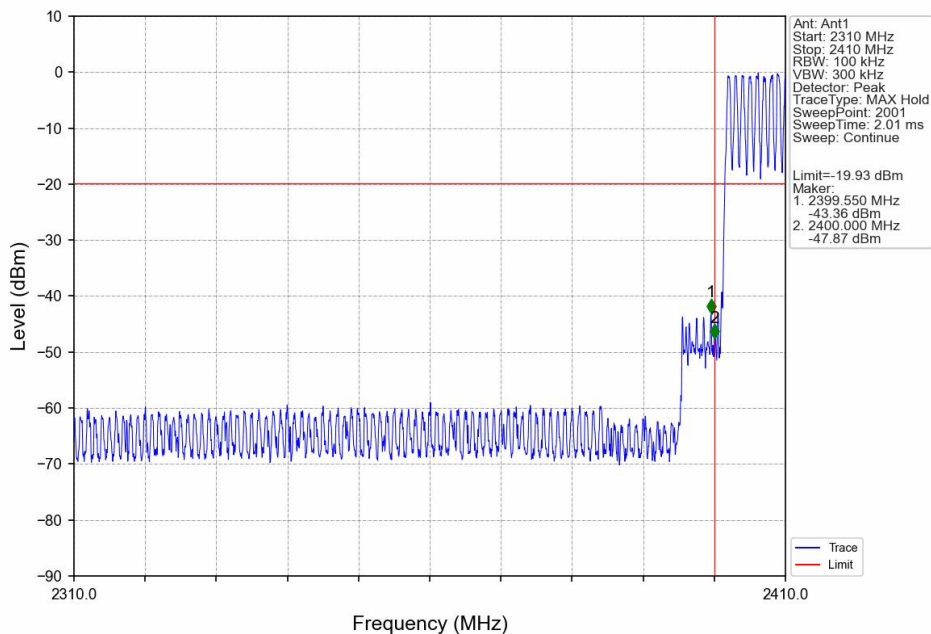


GFSK_DH5_HOPP_Ant1_NTNV

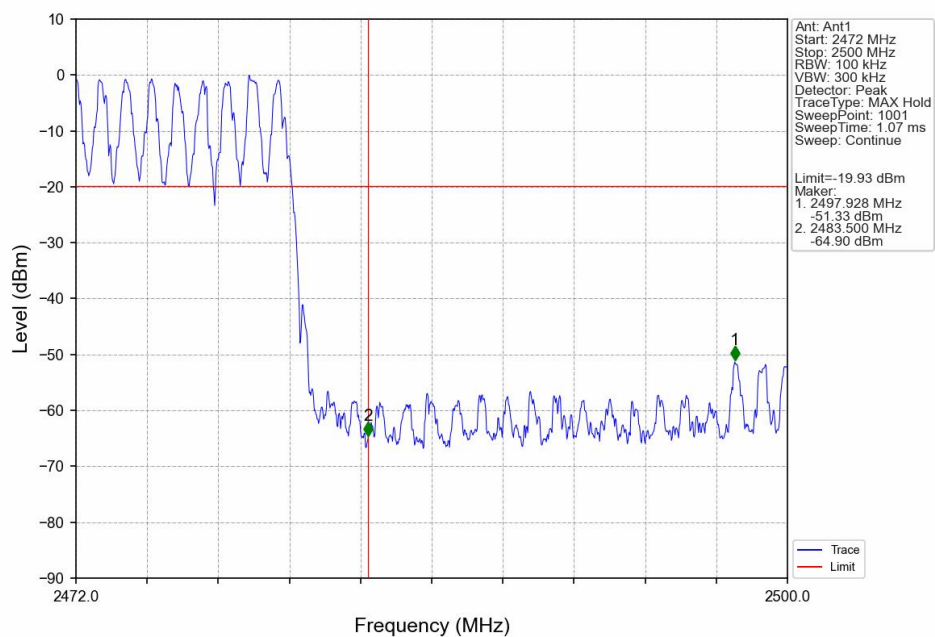


Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

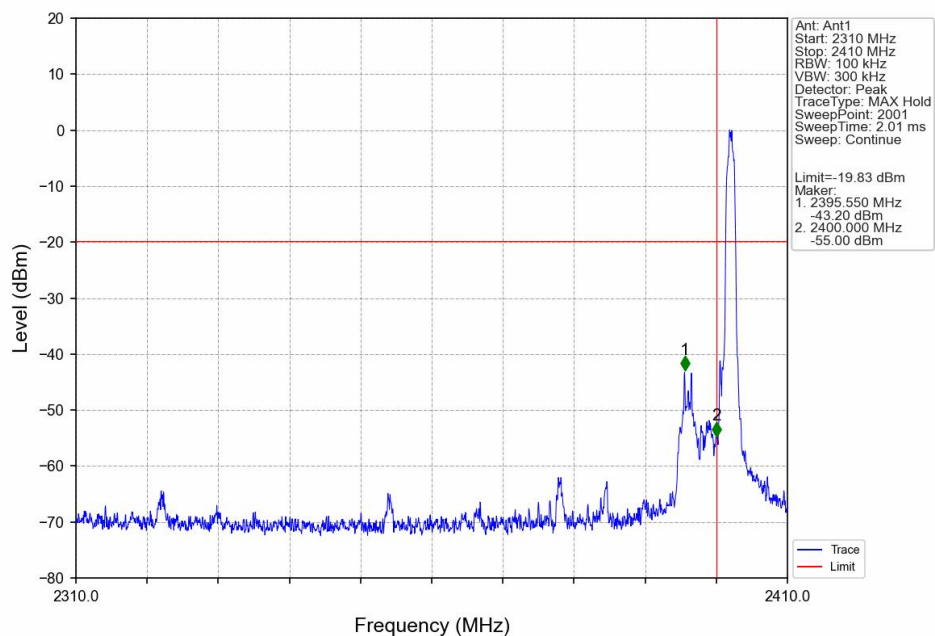


Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

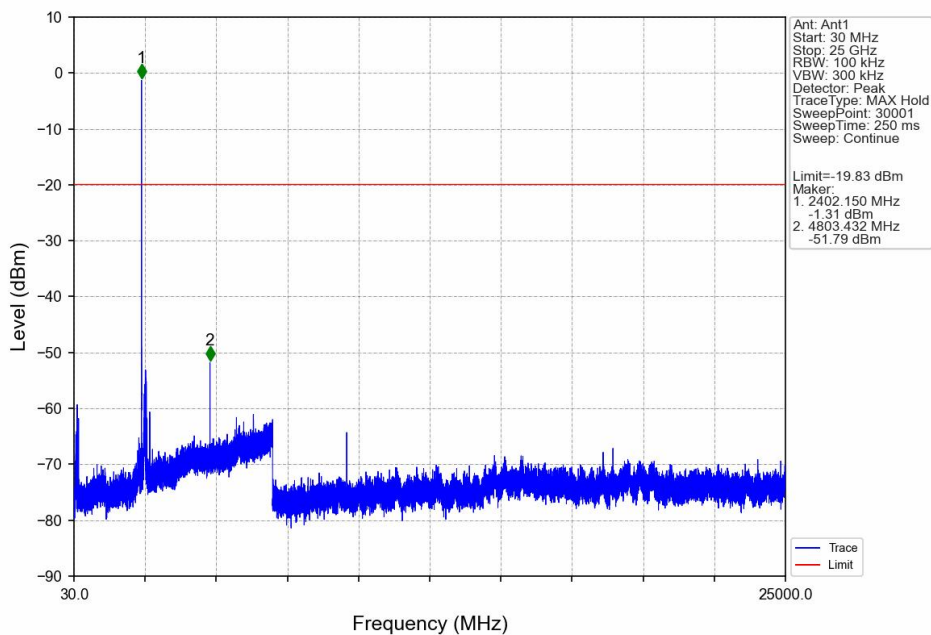


Pi/4DQPSK_2DH5_MCH_2441MHz_Ant1_NTNV

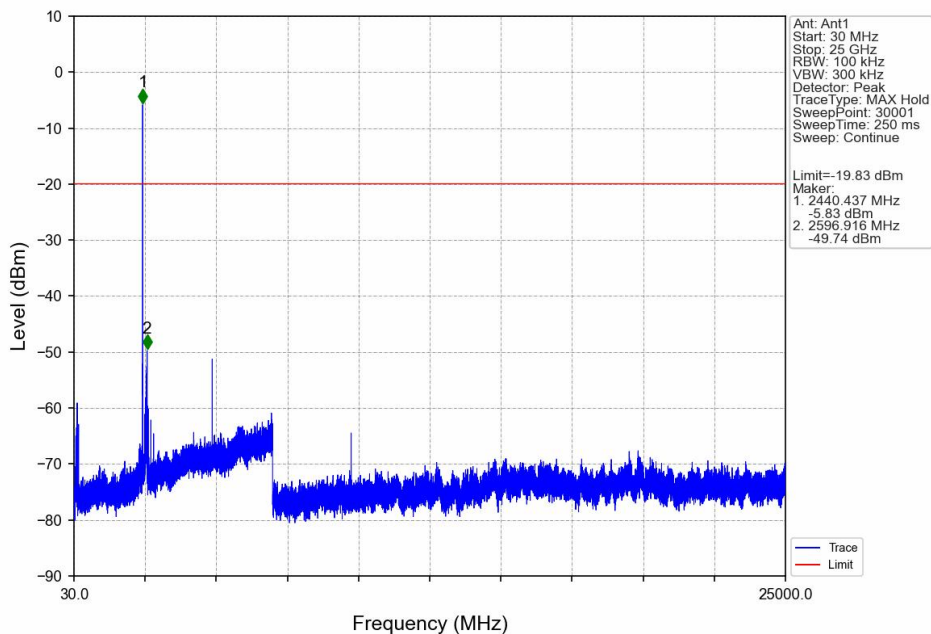


Pi/4DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

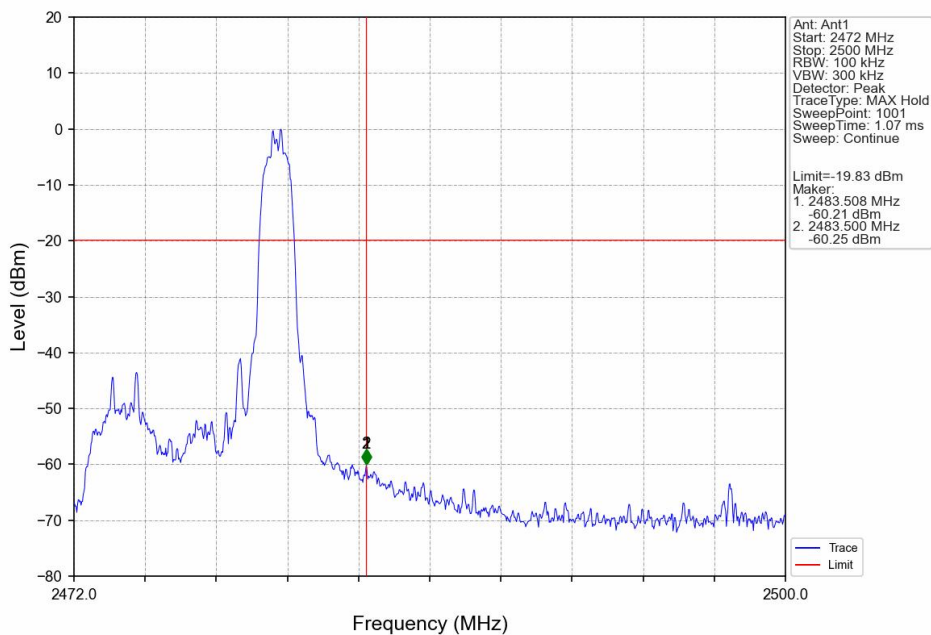


Pi/4DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

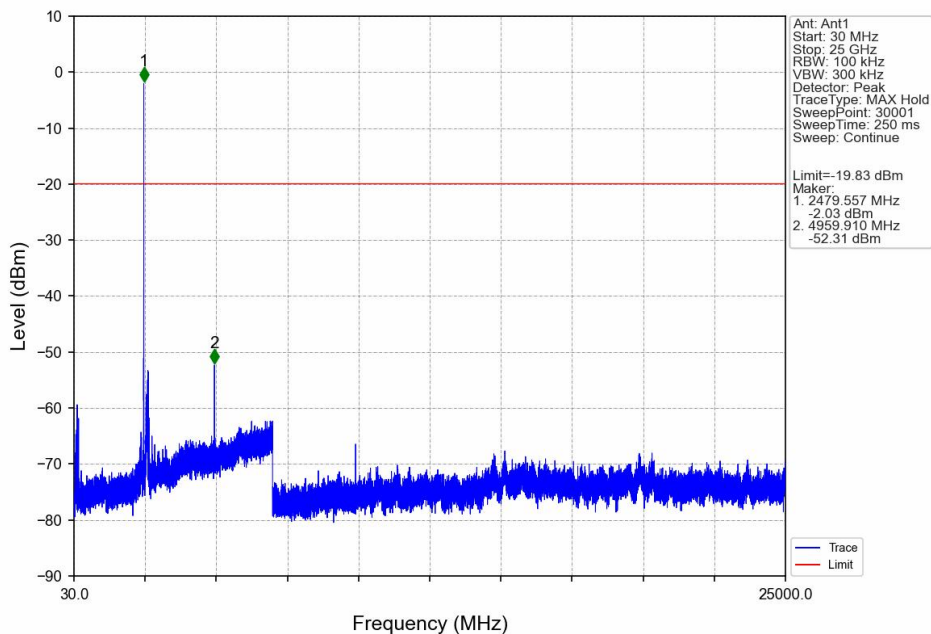


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

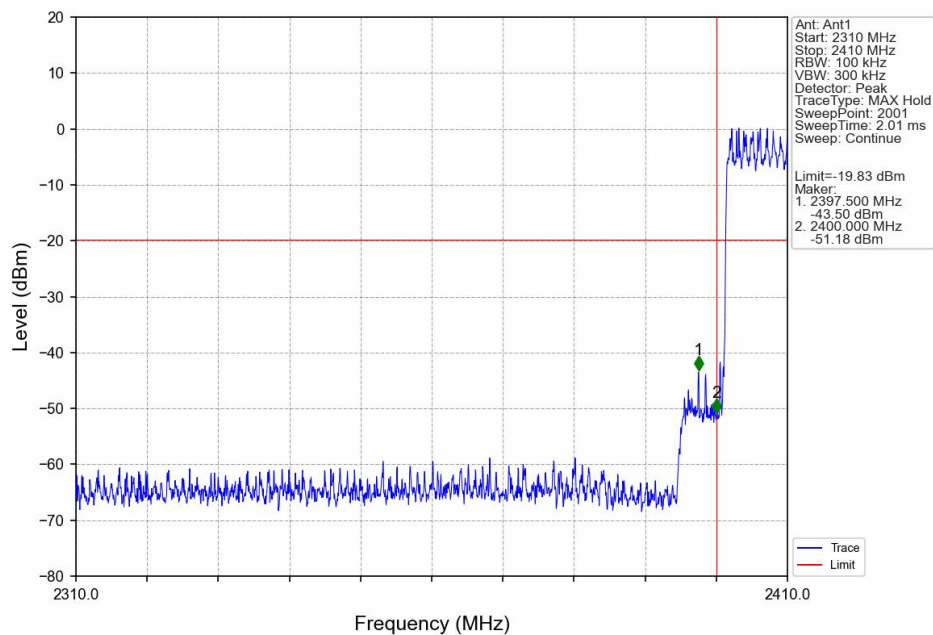


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

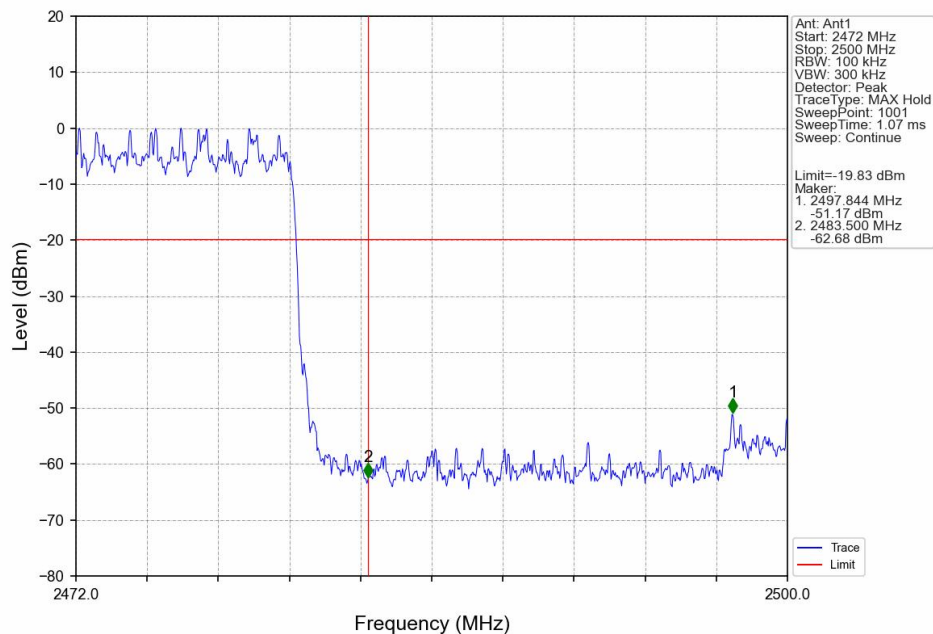


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

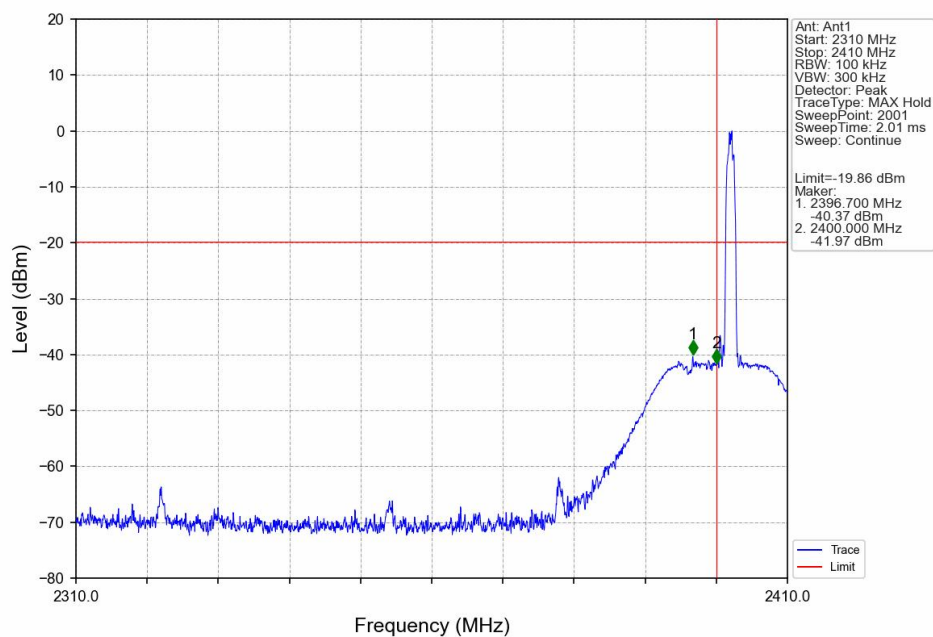


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

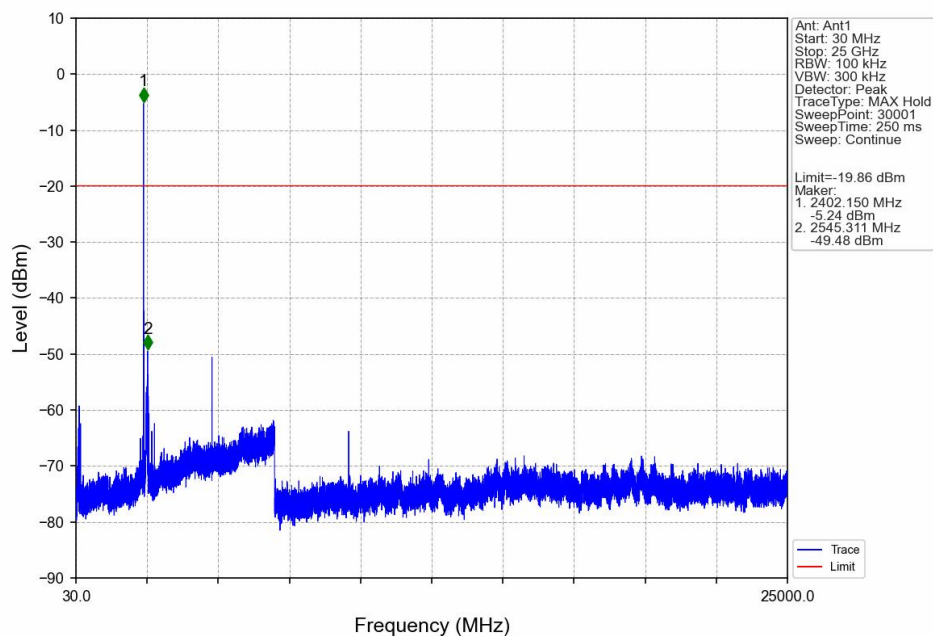


8DPSK_3DH5_MCH_2441MHz_Ant1_NTNV

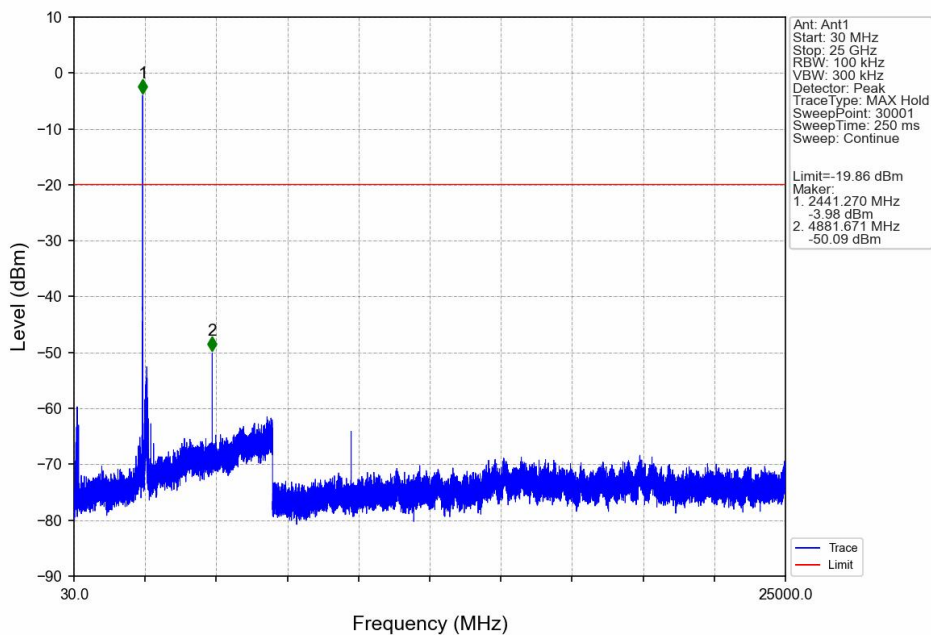


8DPSK_3DH5_HCH_2480MHz_Ant1_NTNV

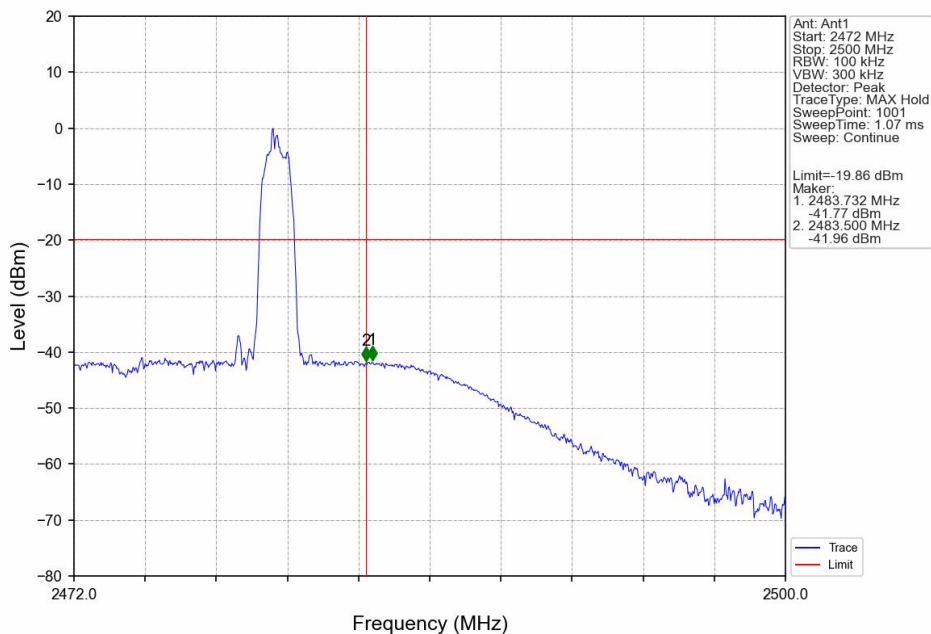


8DPSK_3DH5_HCH_2480MHz_Ant1_NTNV

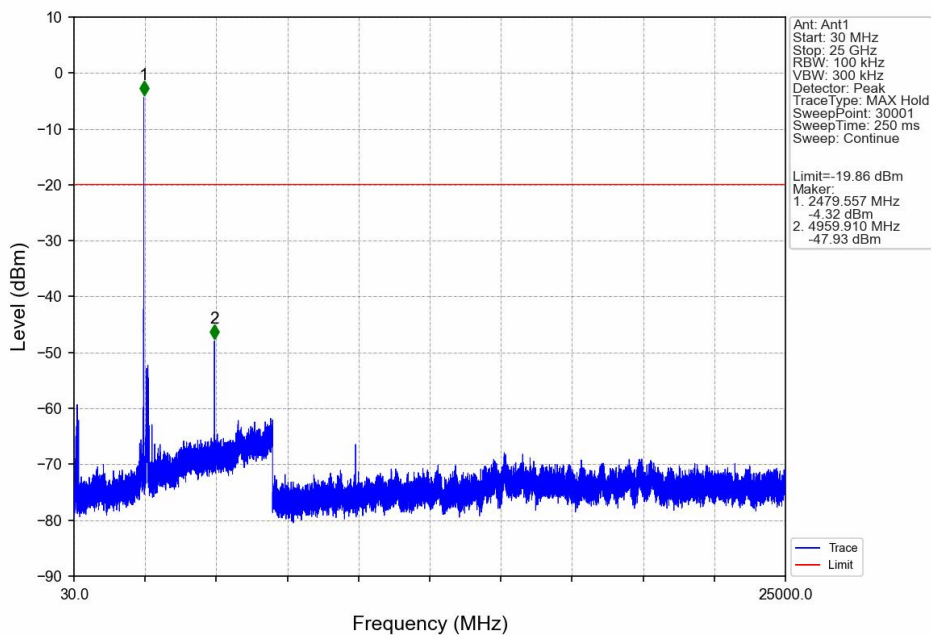

8DPSK_3DH5_HOPP_Ant1_NTNV

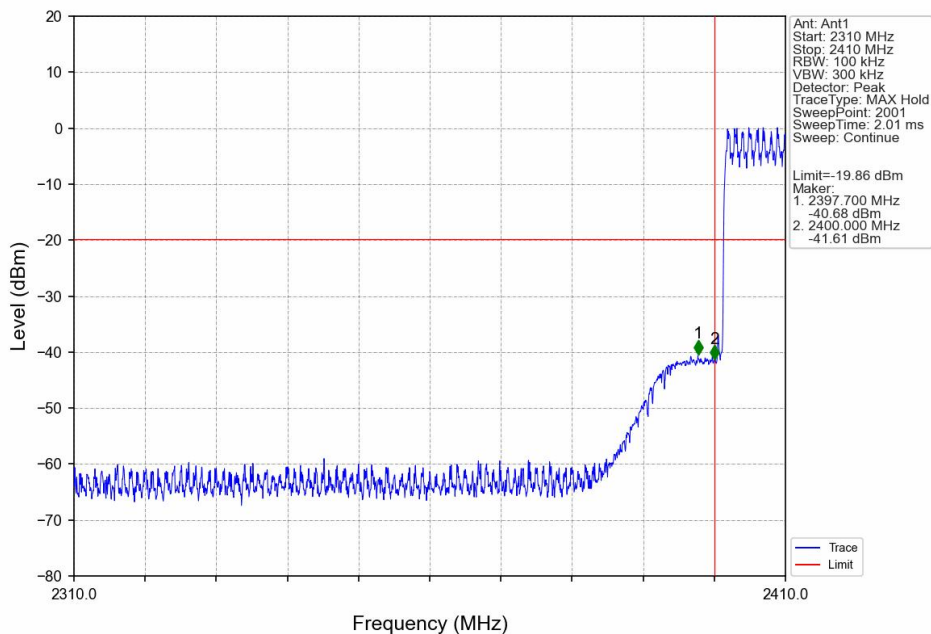

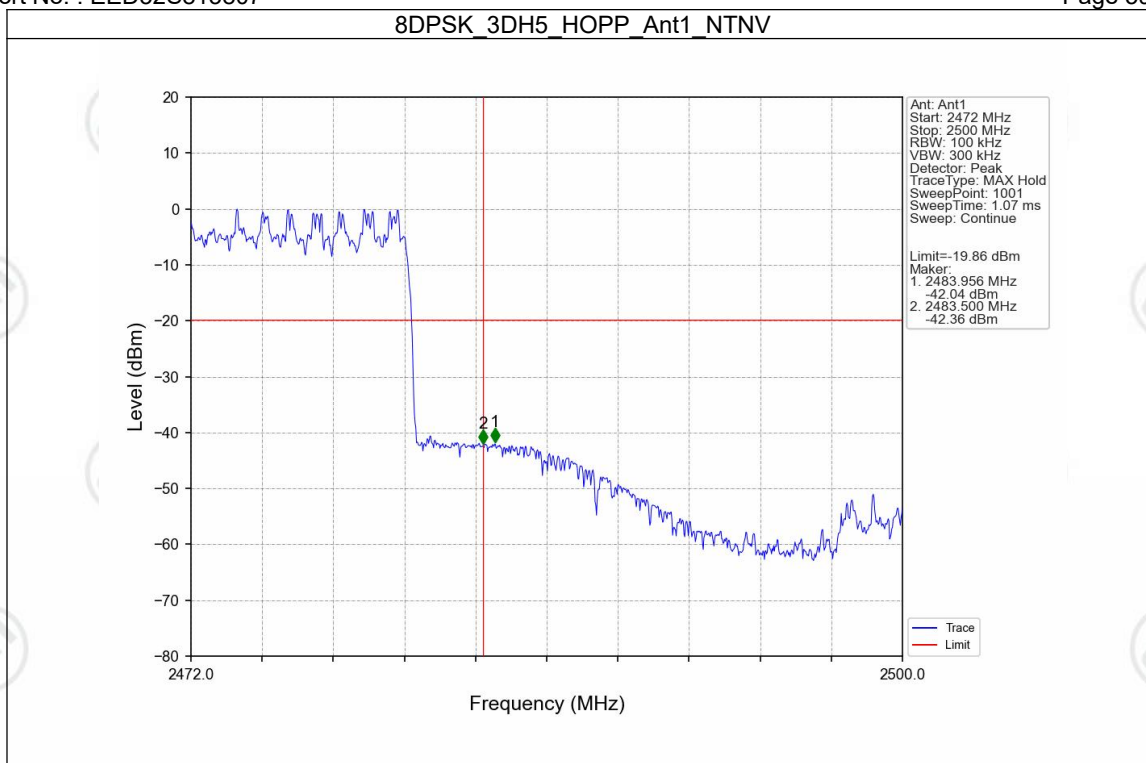

*** End of Report ***