




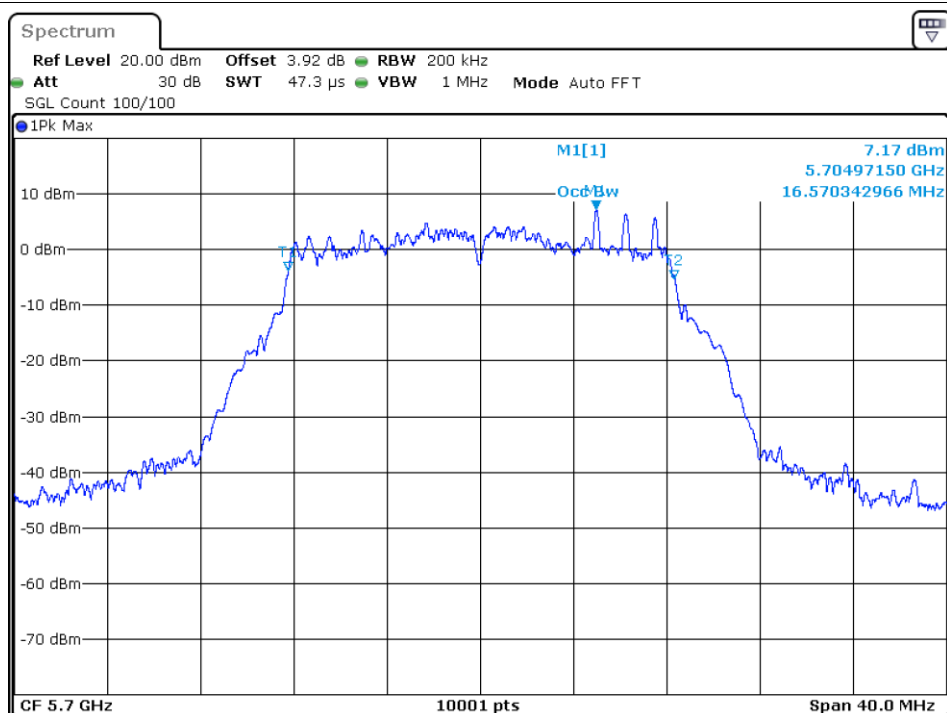


OBW NVNT a 5700MHz Ant1

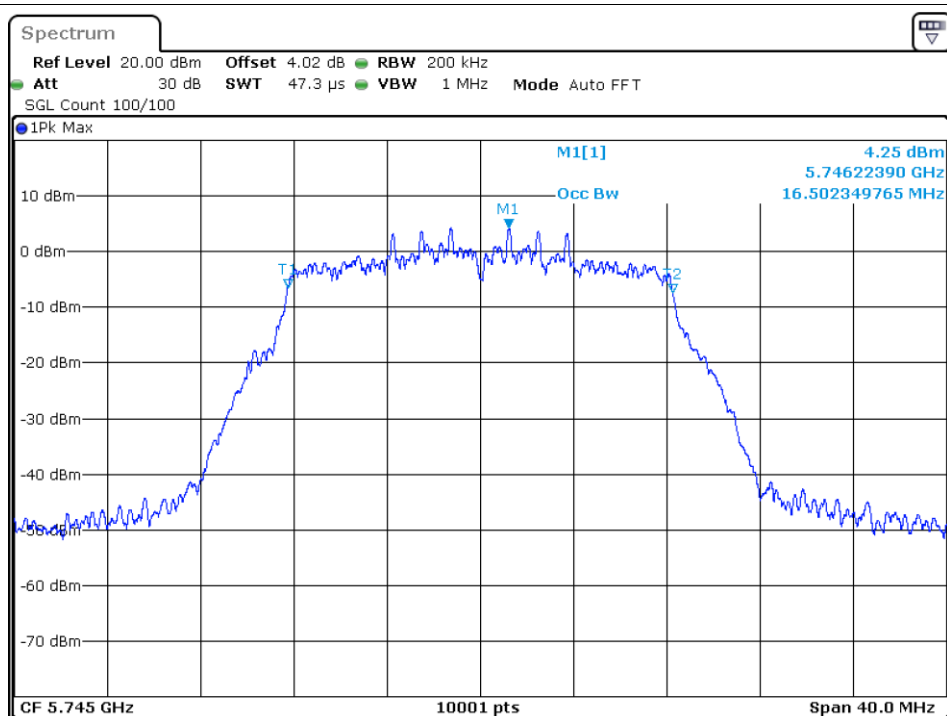


OBW NVNT a 5745MHz Ant1

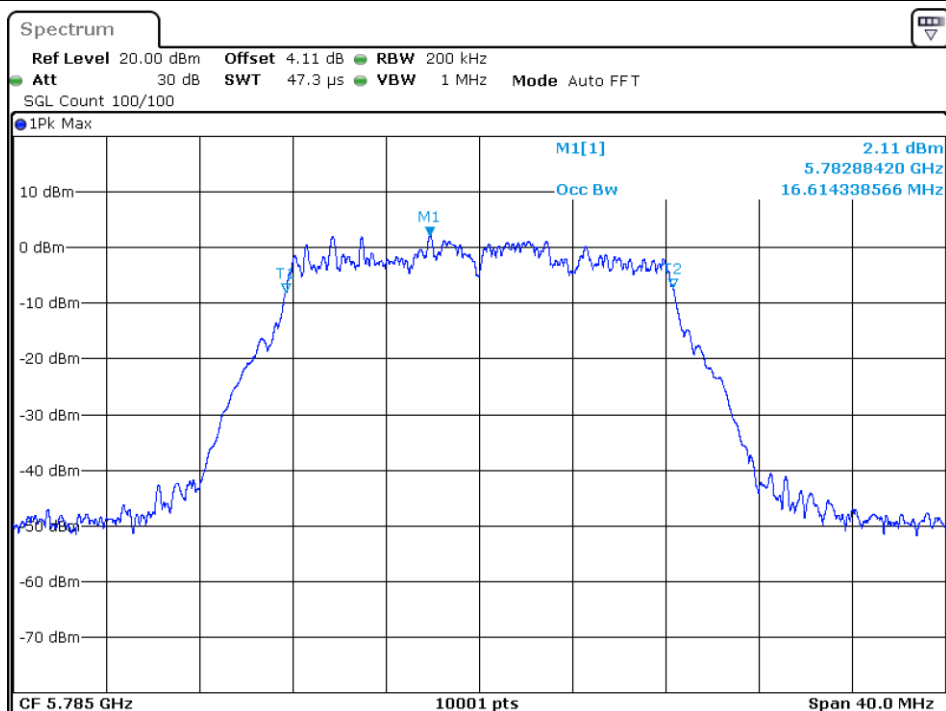


OBW NVNT a 5785MHz Ant1

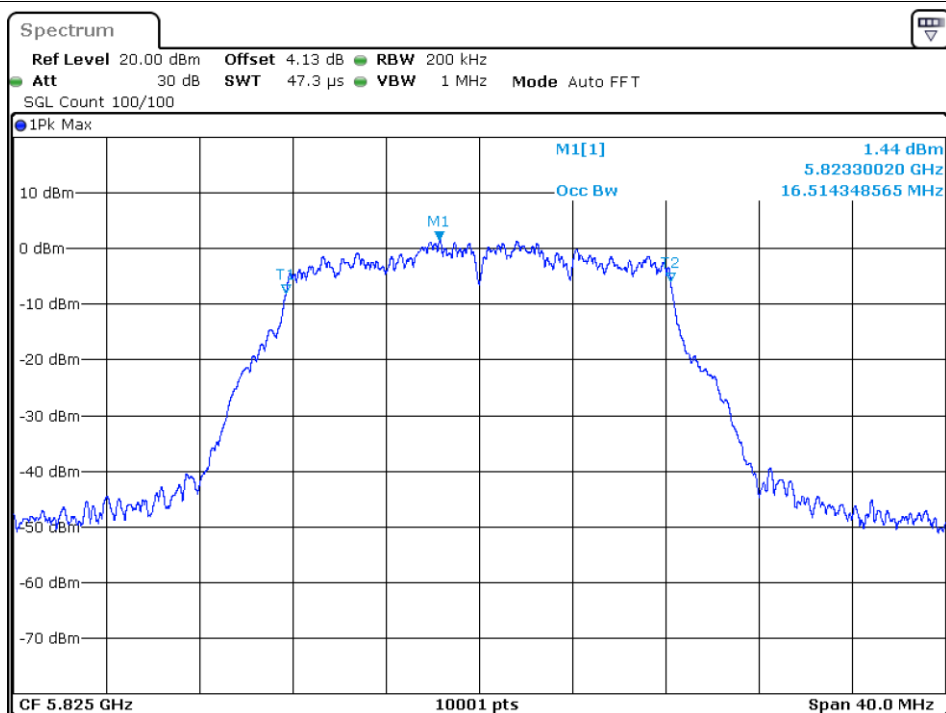


OBW NVNT a 5825MHz Ant1

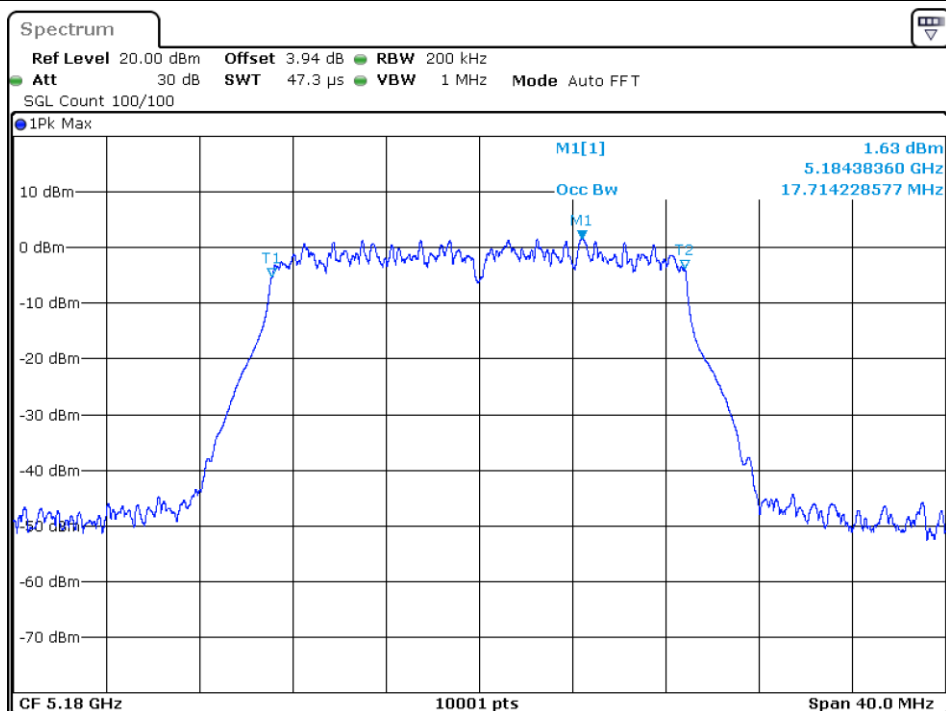


OBW NVNT n20 5180MHz Ant1

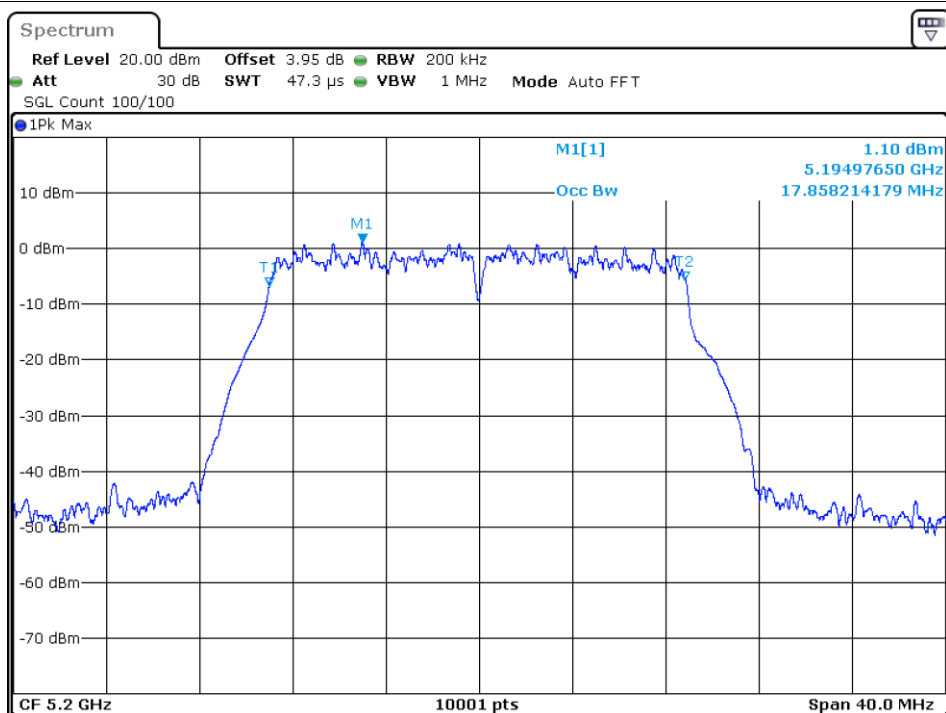


OBW NVNT n20 5200MHz Ant1

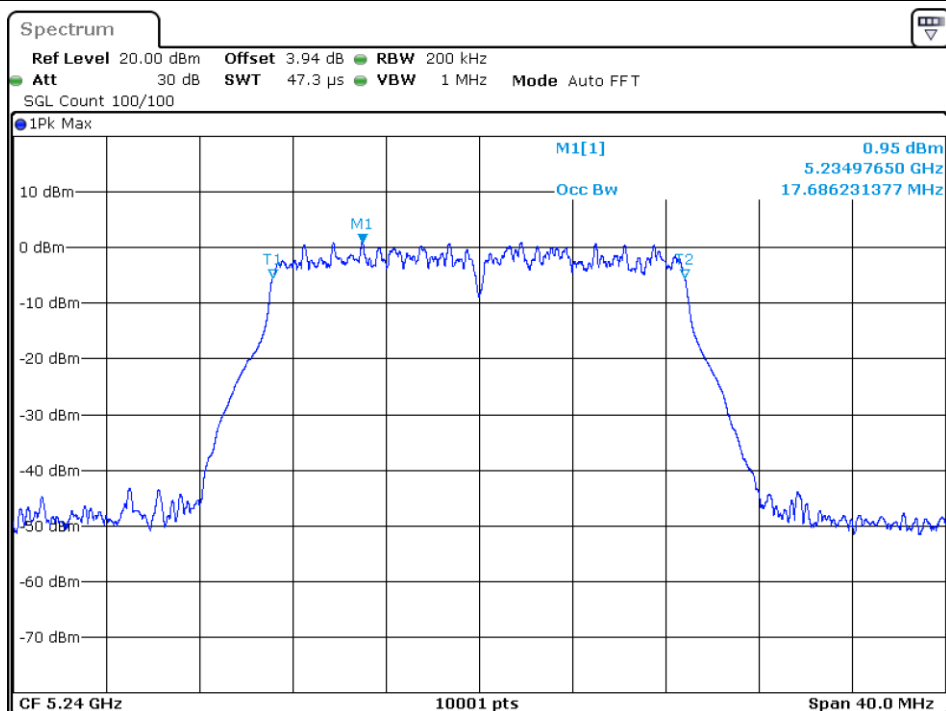


OBW NVNT n20 5240MHz Ant1

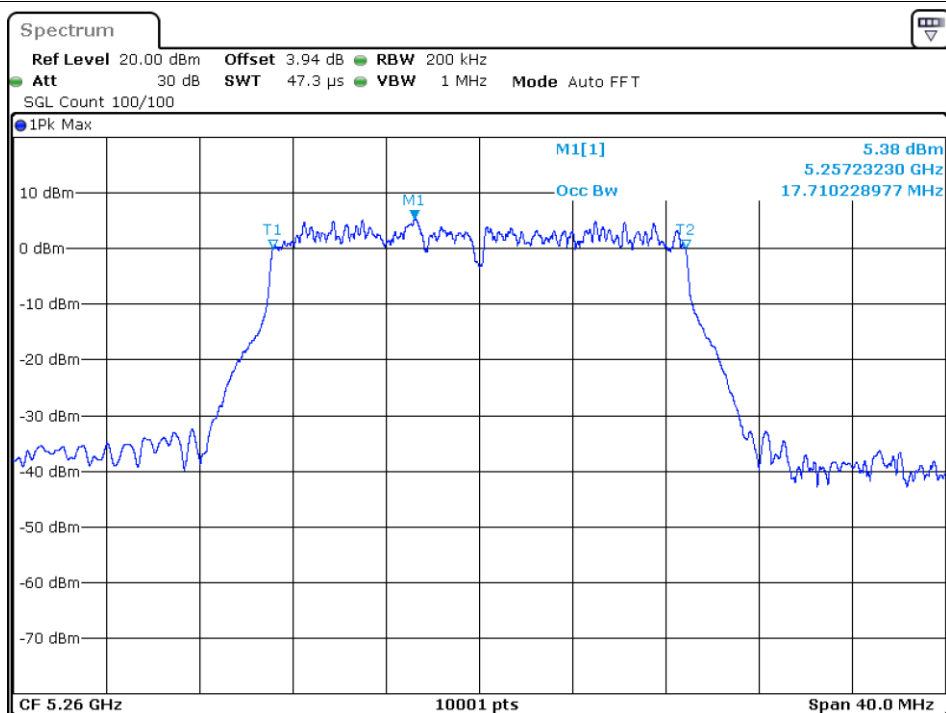


OBW NVNT n20 5260MHz Ant1

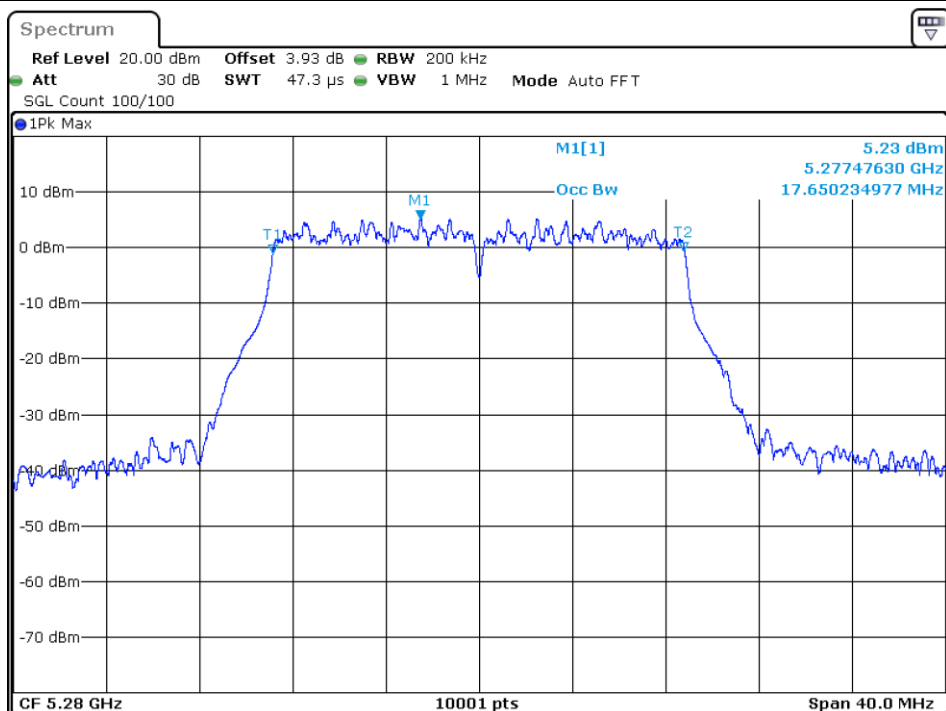


OBW NVNT n20 5280MHz Ant1

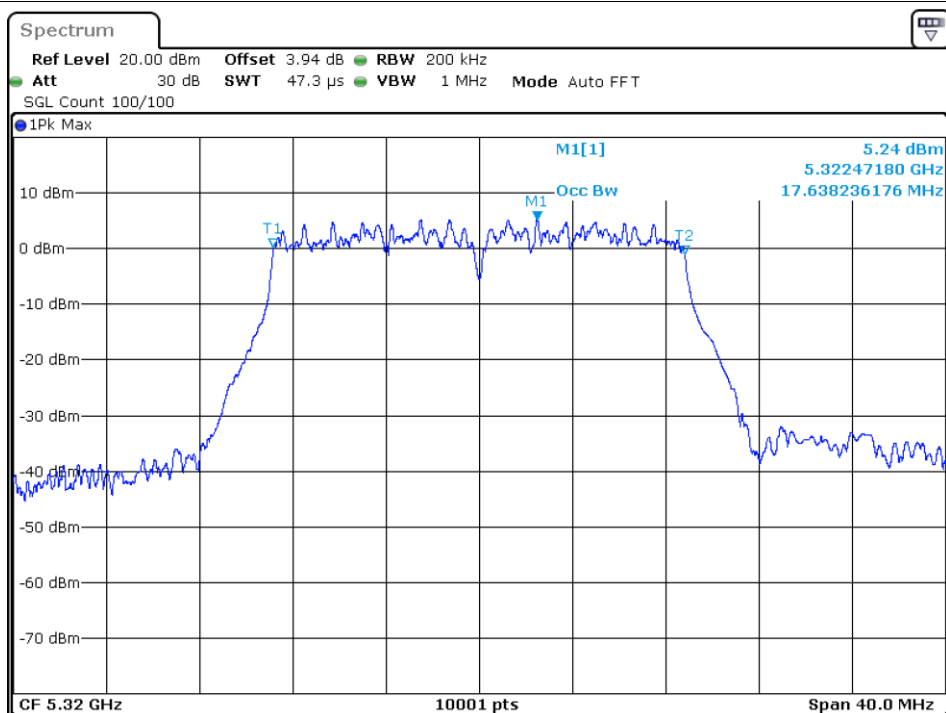


OBW NVNT n20 5320MHz Ant1

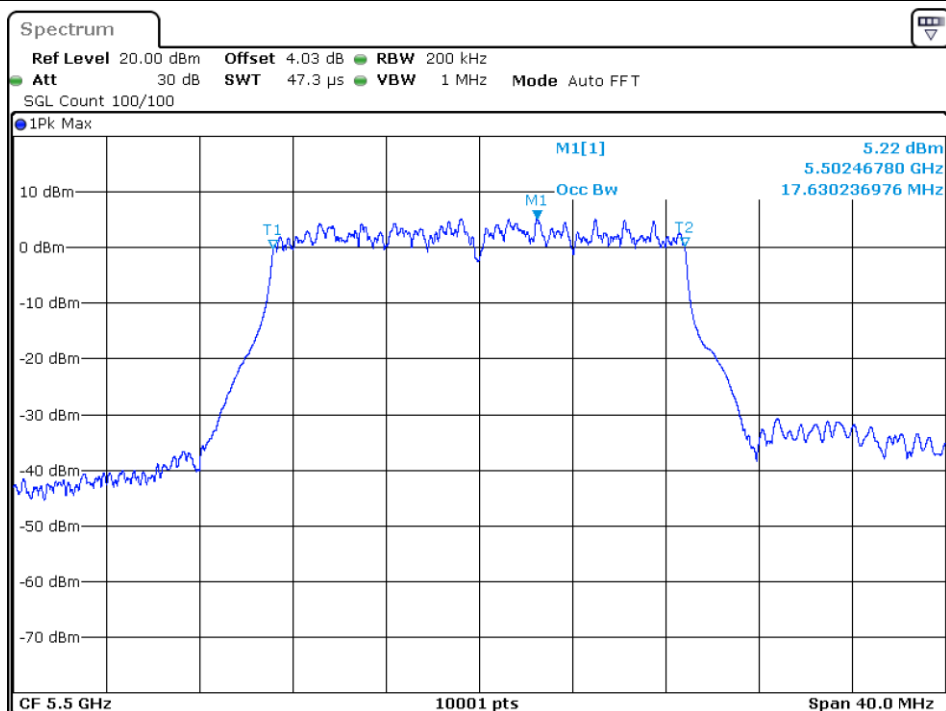


OBW NVNT n20 5500MHz Ant1

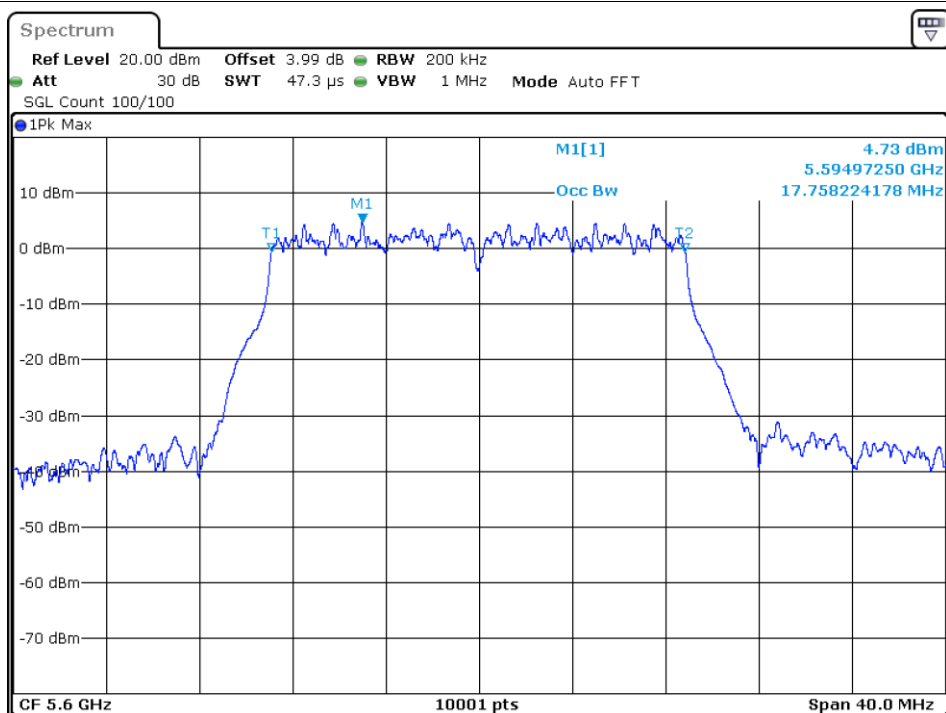


OBW NVNT n20 5600MHz Ant1

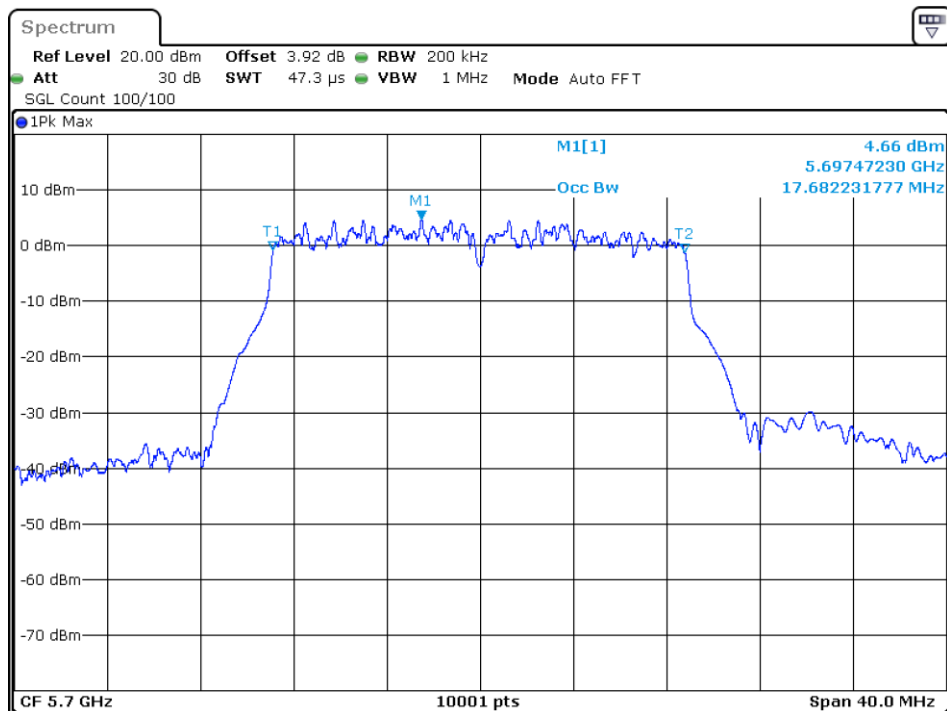


OBW NVNT n20 5700MHz Ant1

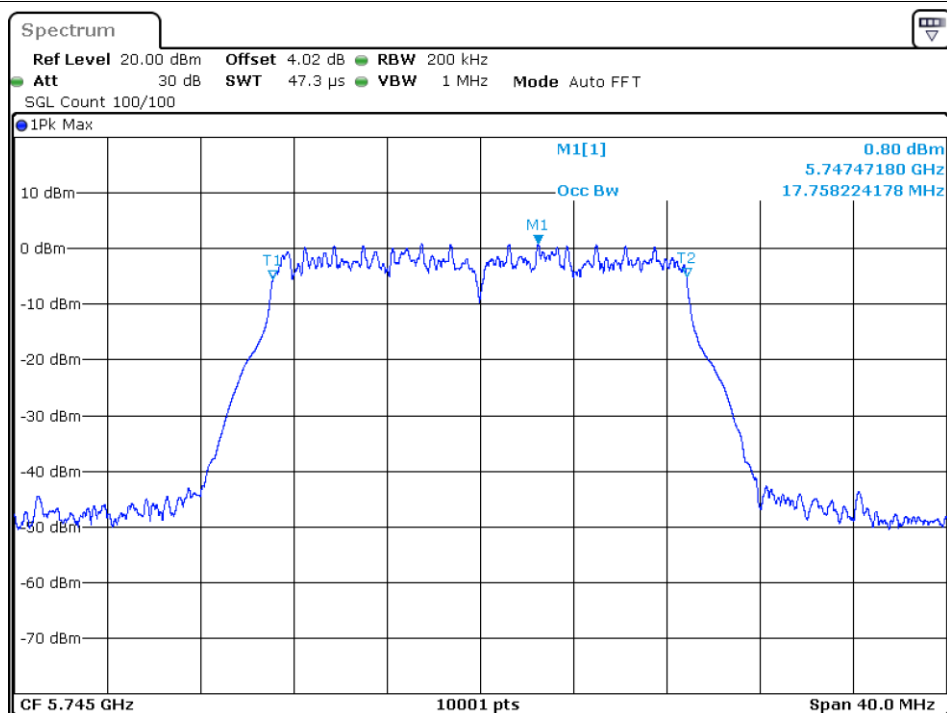


OBW NVNT n20 5745MHz Ant1

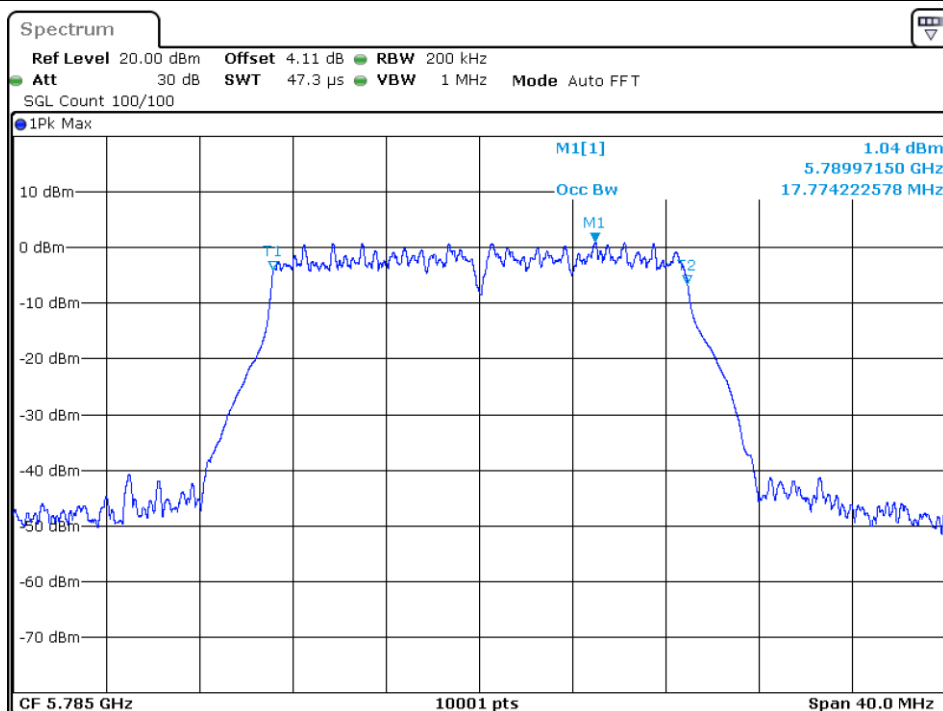


OBW NVNT n20 5785MHz Ant1

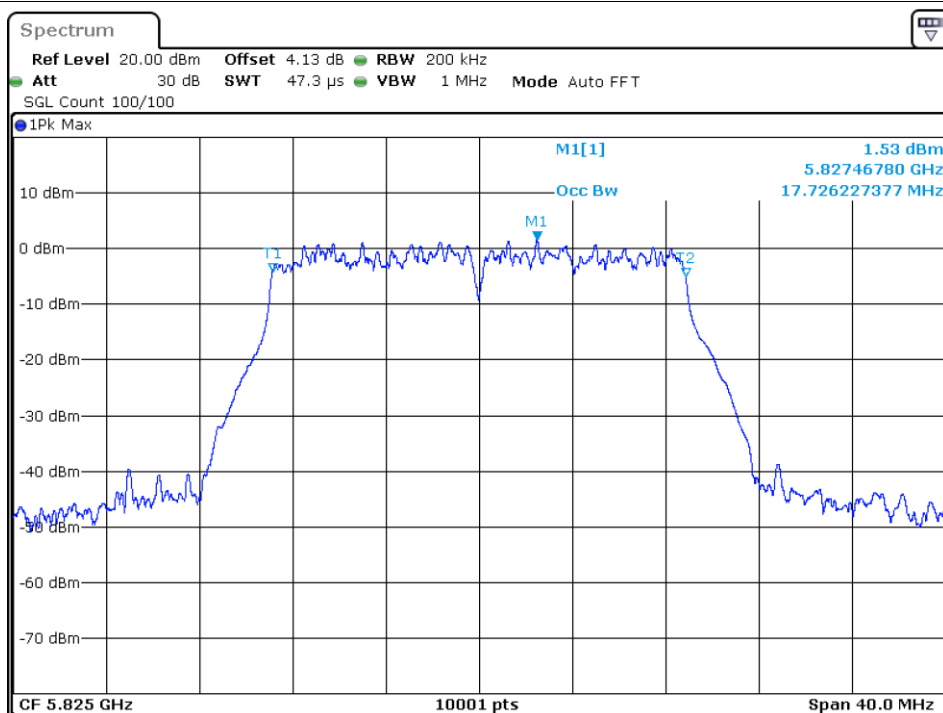


OBW NVNT n20 5825MHz Ant1

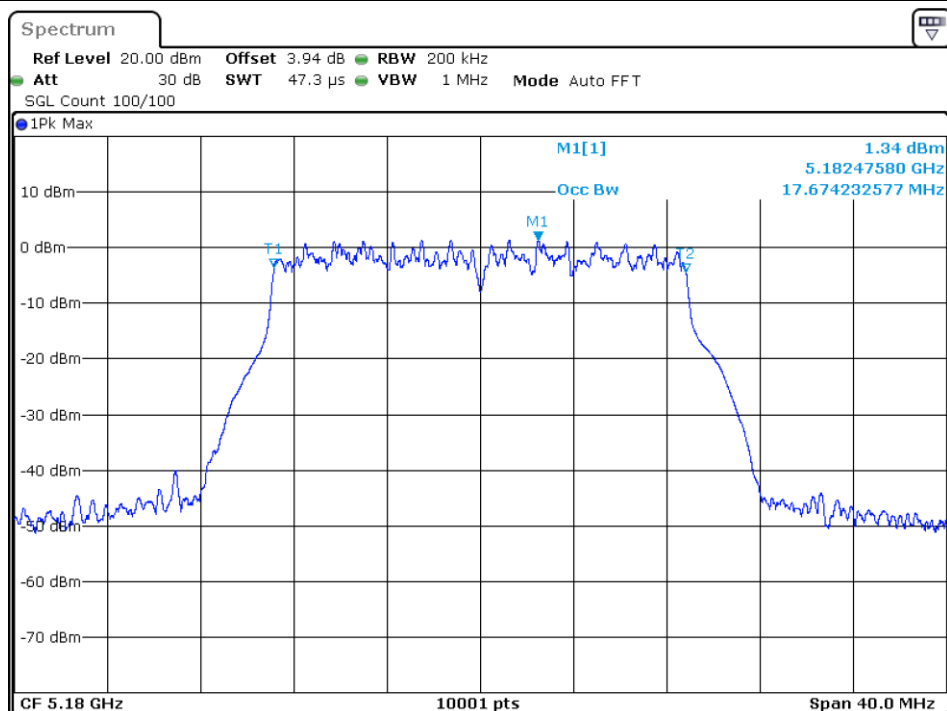


OBW NVNT ac20 5180MHz Ant1

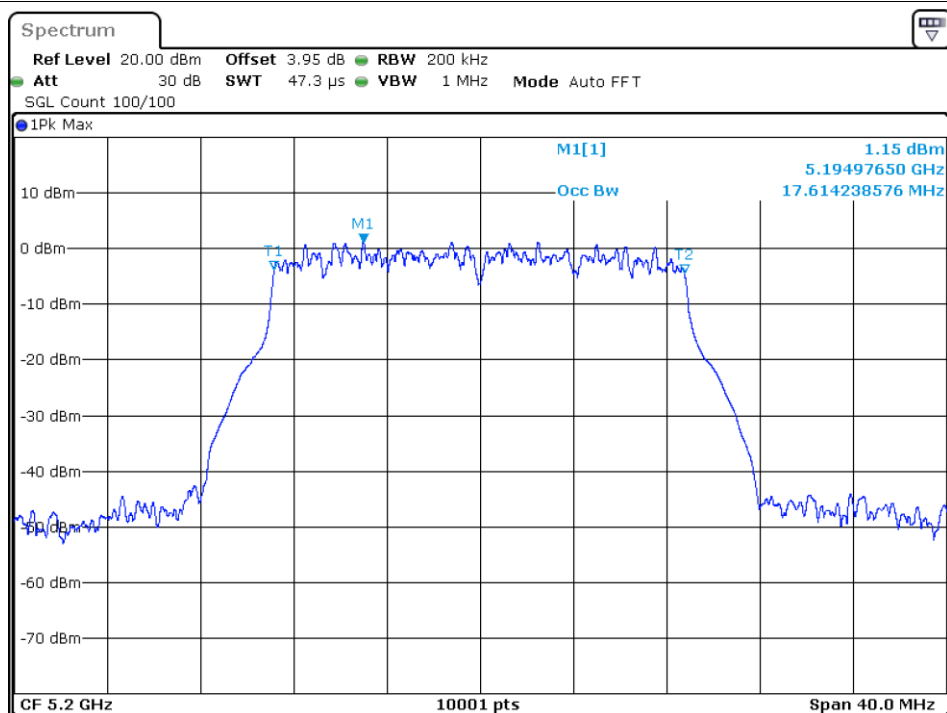


OBW NVNT ac20 5200MHz Ant1

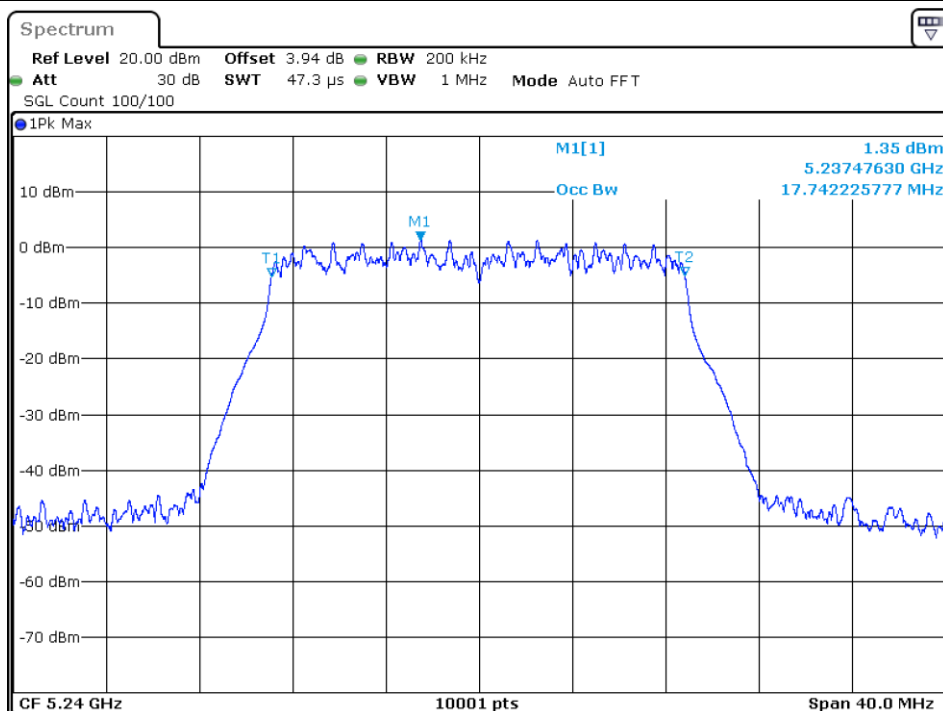


OBW NVNT ac20 5240MHz Ant1

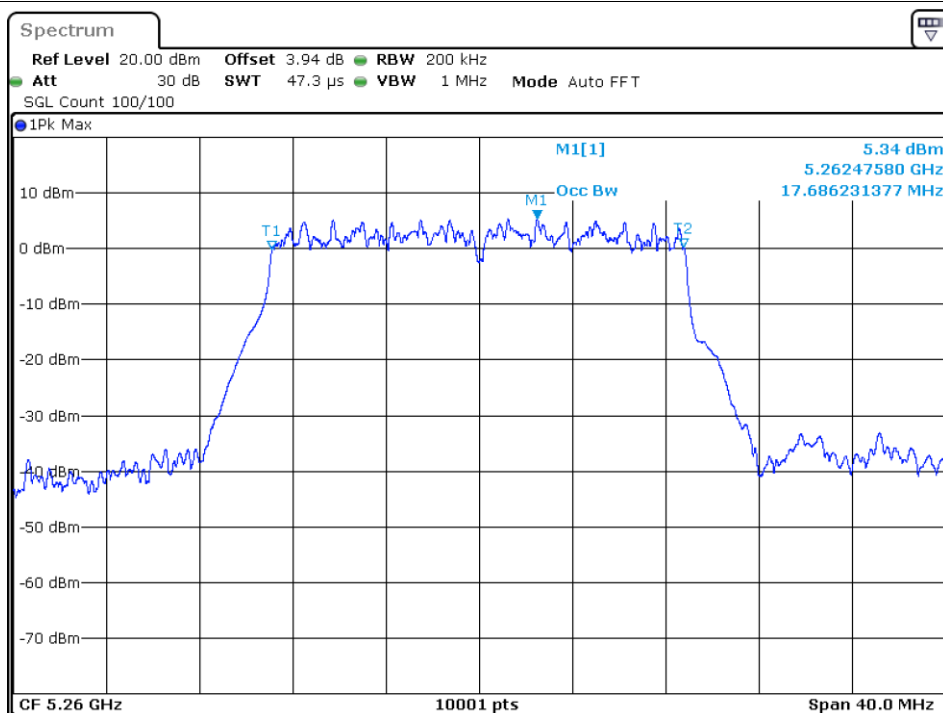


OBW NVNT ac20 5260MHz Ant1

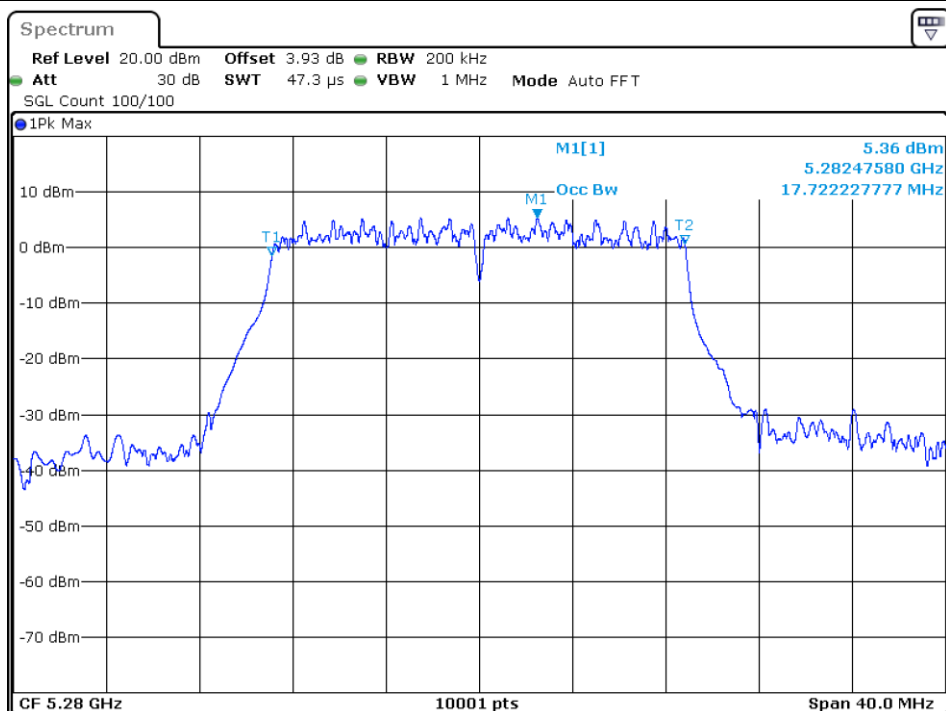


OBW NVNT ac20 5280MHz Ant1

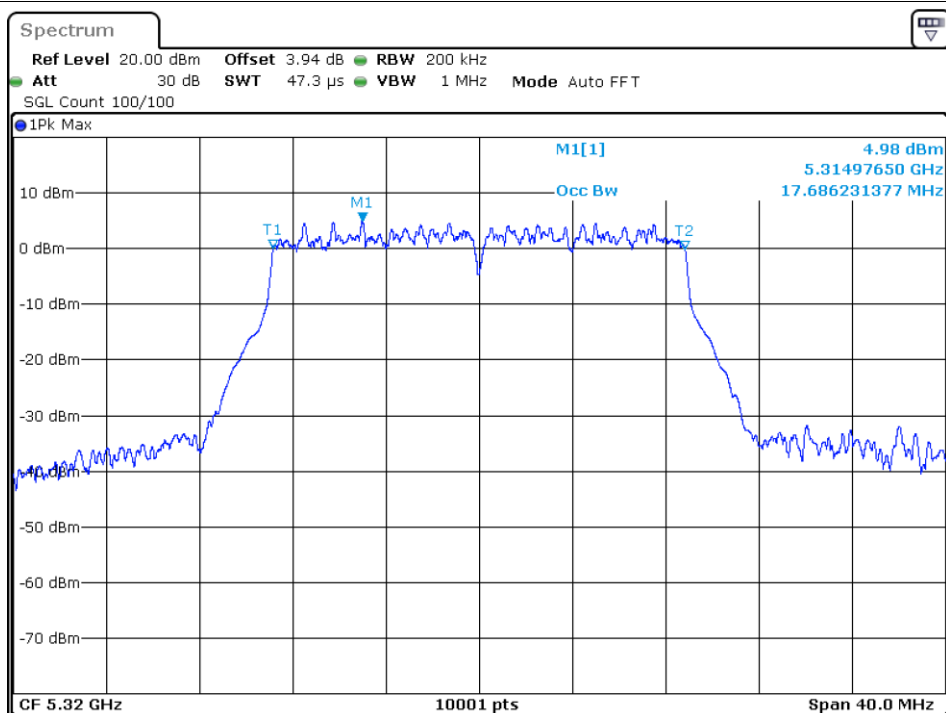


OBW NVNT ac20 5320MHz Ant1

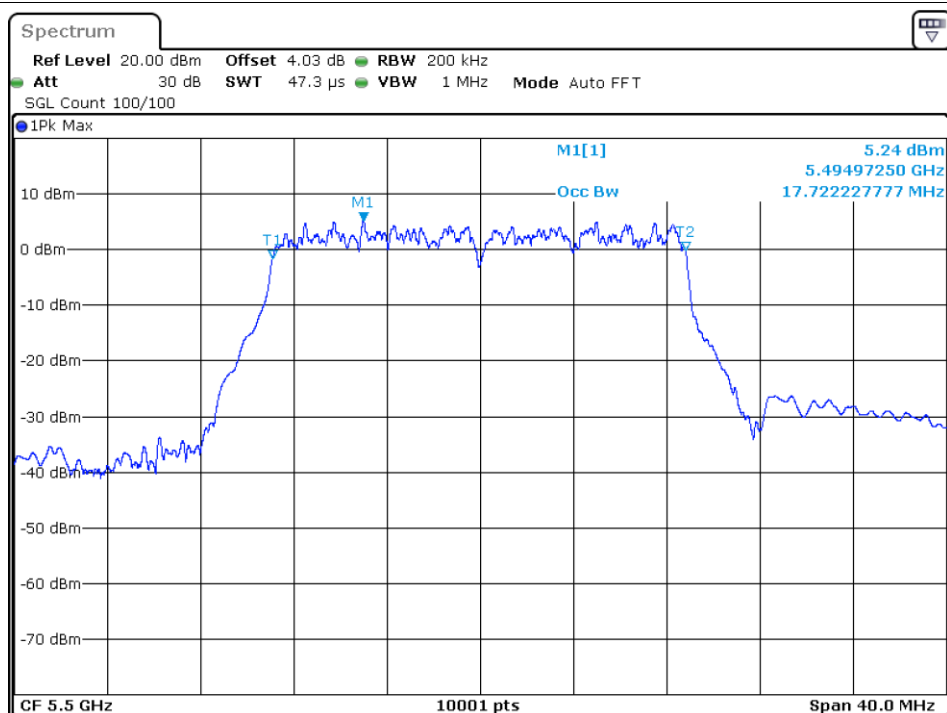


OBW NVNT ac20 5500MHz Ant1

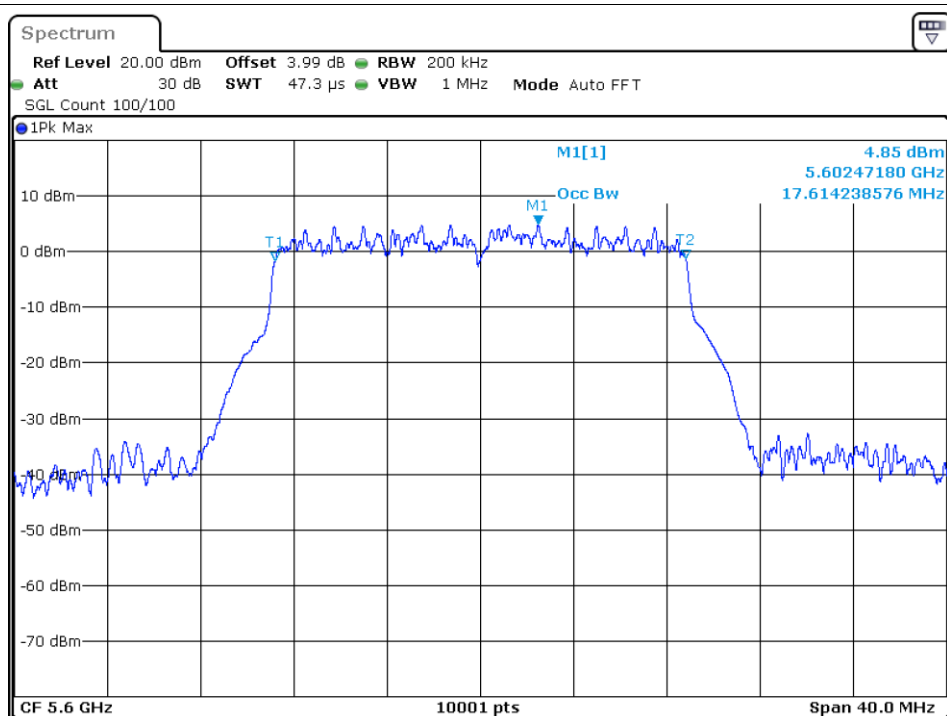


OBW NVNT ac20 5600MHz Ant1

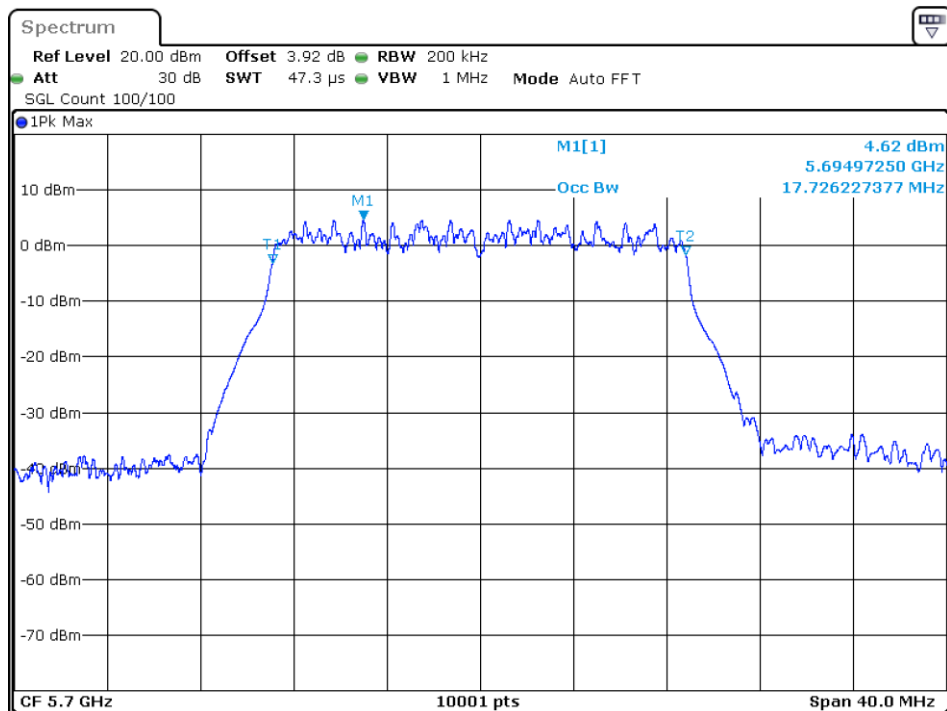


OBW NVNT ac20 5700MHz Ant1

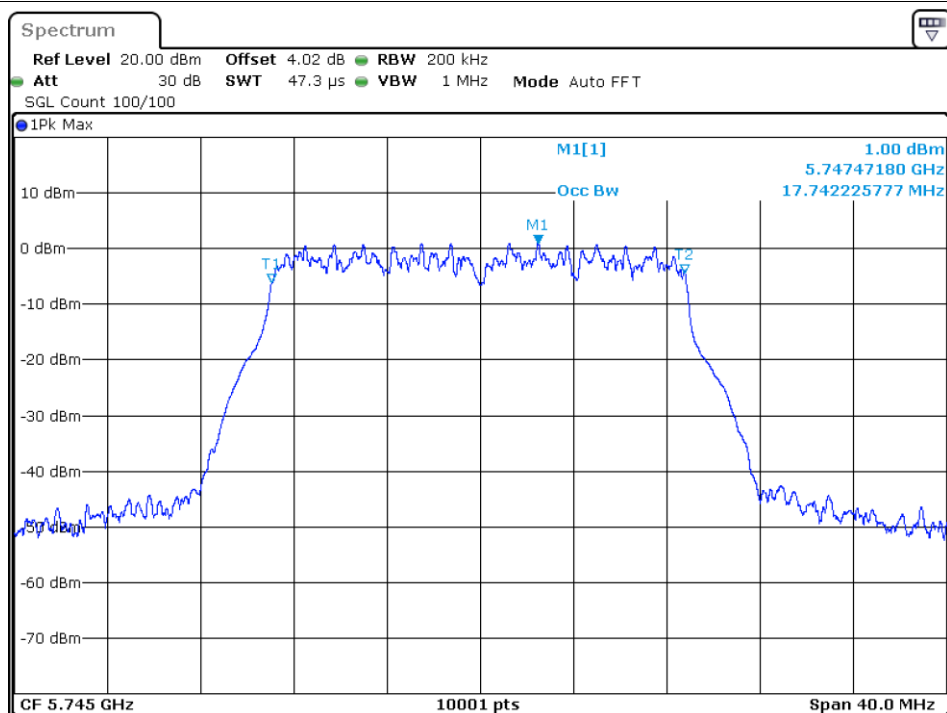


OBW NVNT ac20 5745MHz Ant1

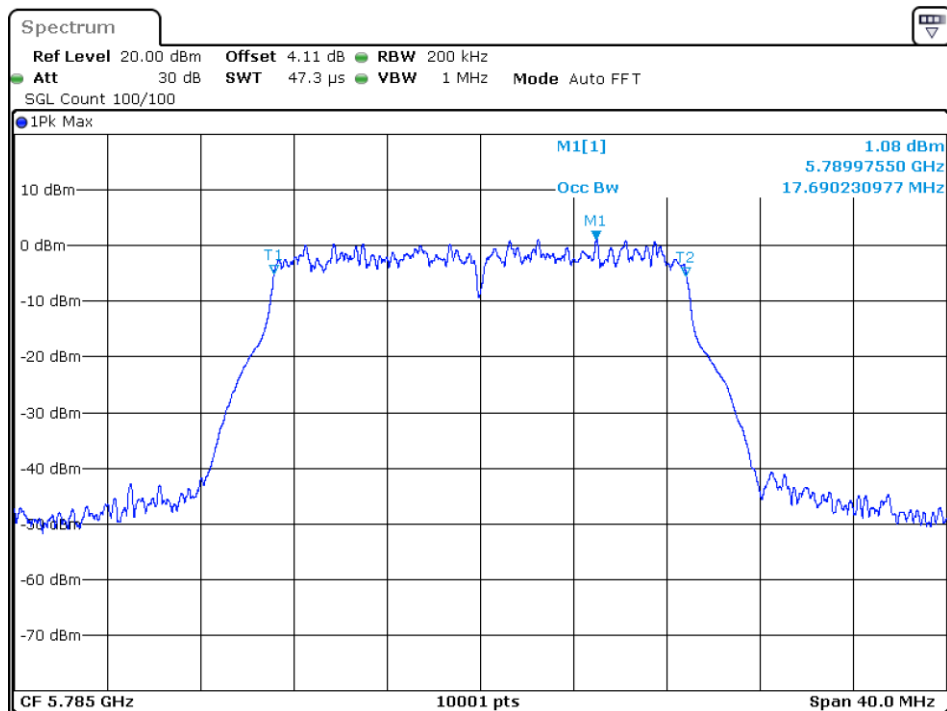


OBW NVNT ac20 5785MHz Ant1

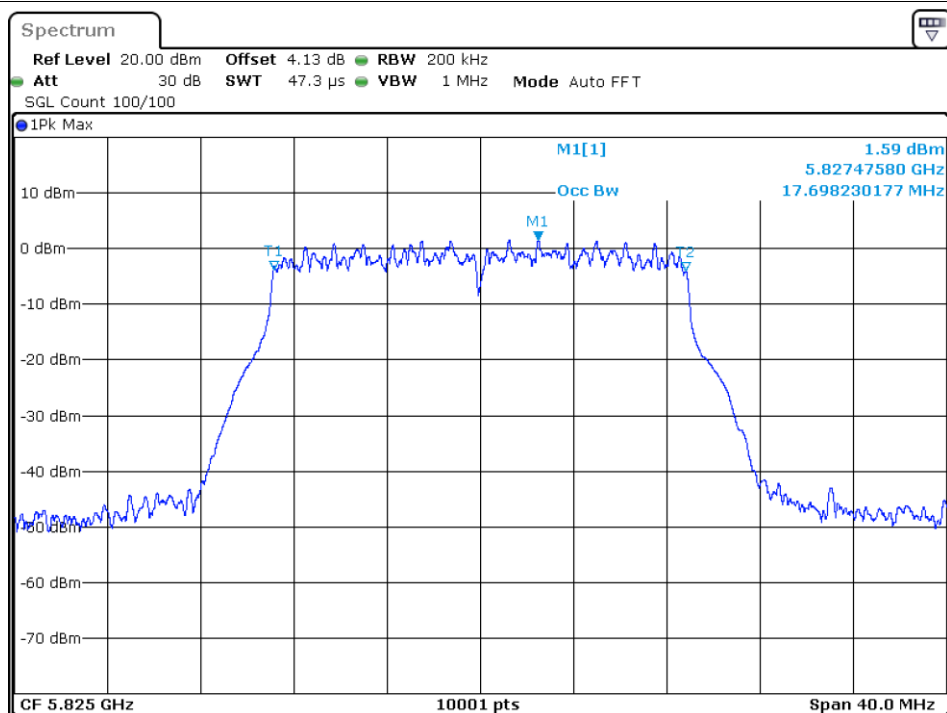


OBW NVNT ac20 5825MHz Ant1

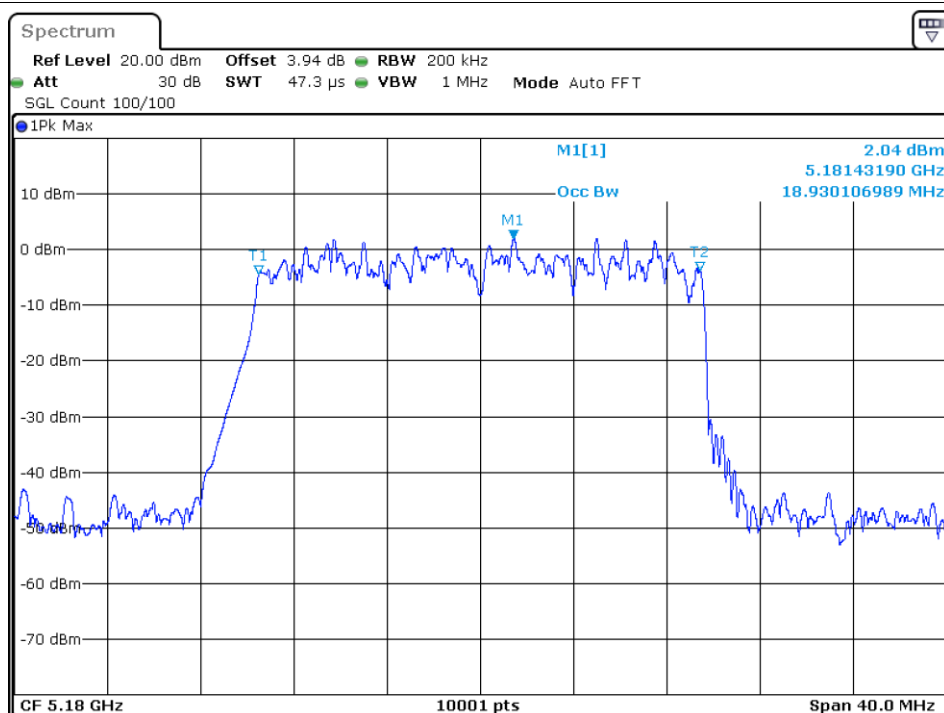


OBW NVNT ax20 5180MHz Ant1

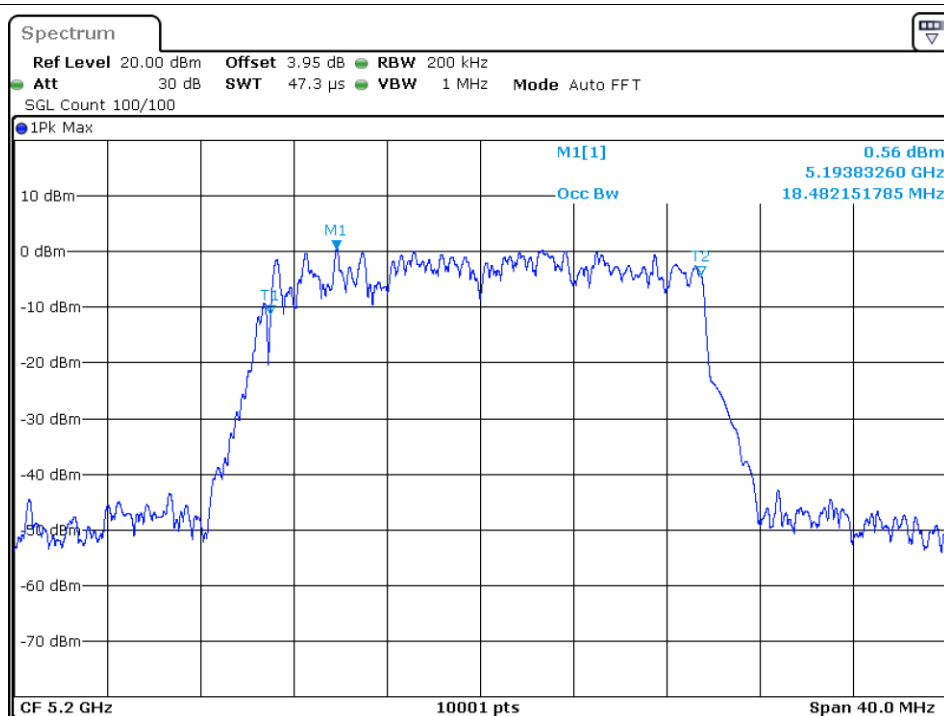


OBW NVNT ax20 5200MHz Ant1

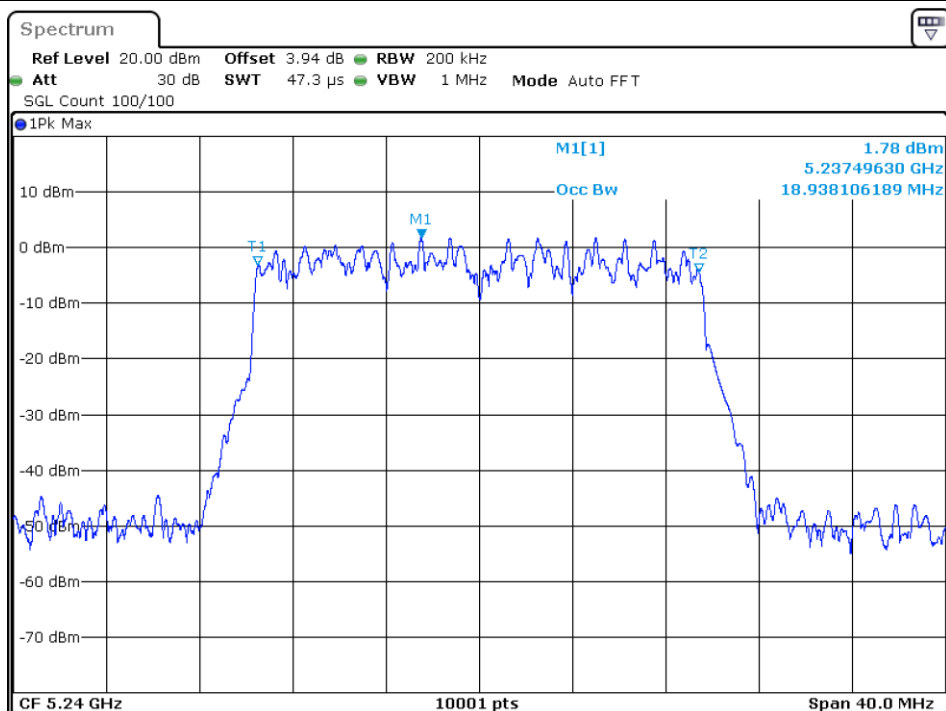


OBW NVNT ax20 5240MHz Ant1

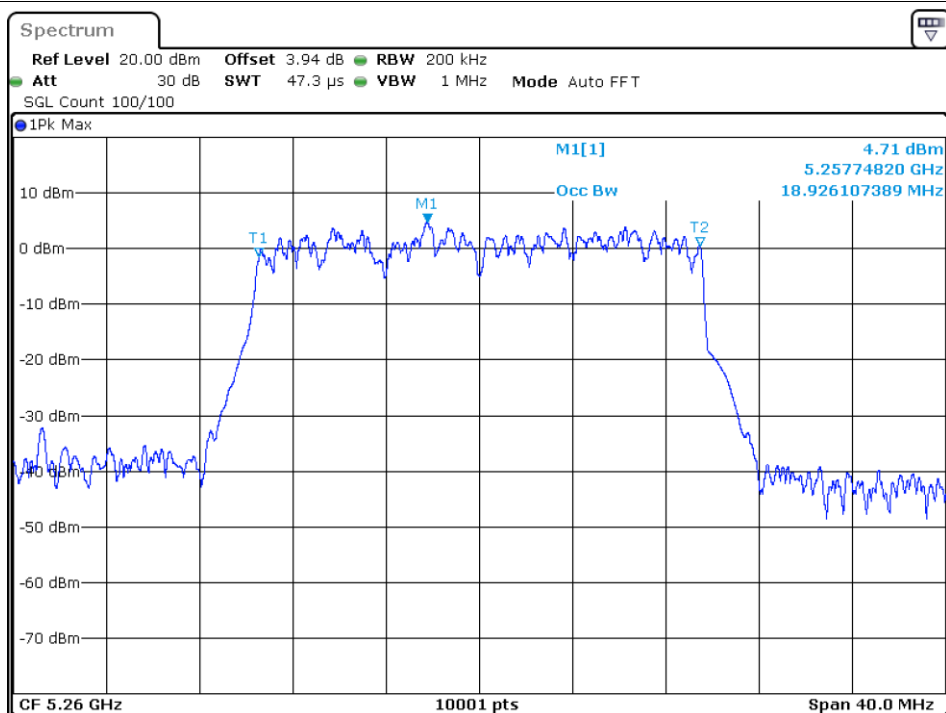


OBW NVNT ax20 5260MHz Ant1

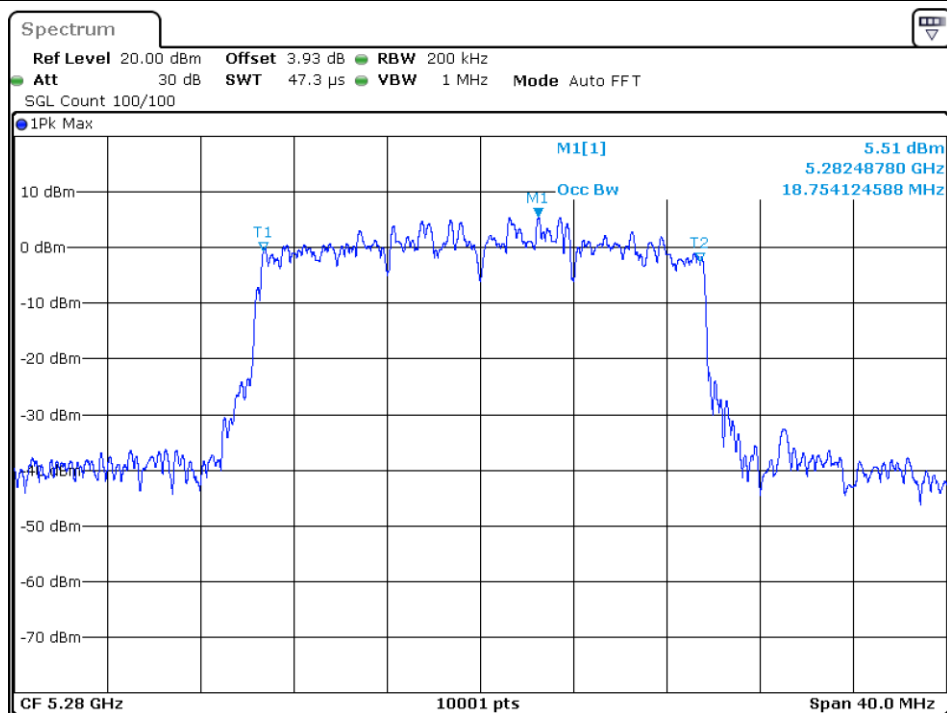


OBW NVNT ax20 5280MHz Ant1

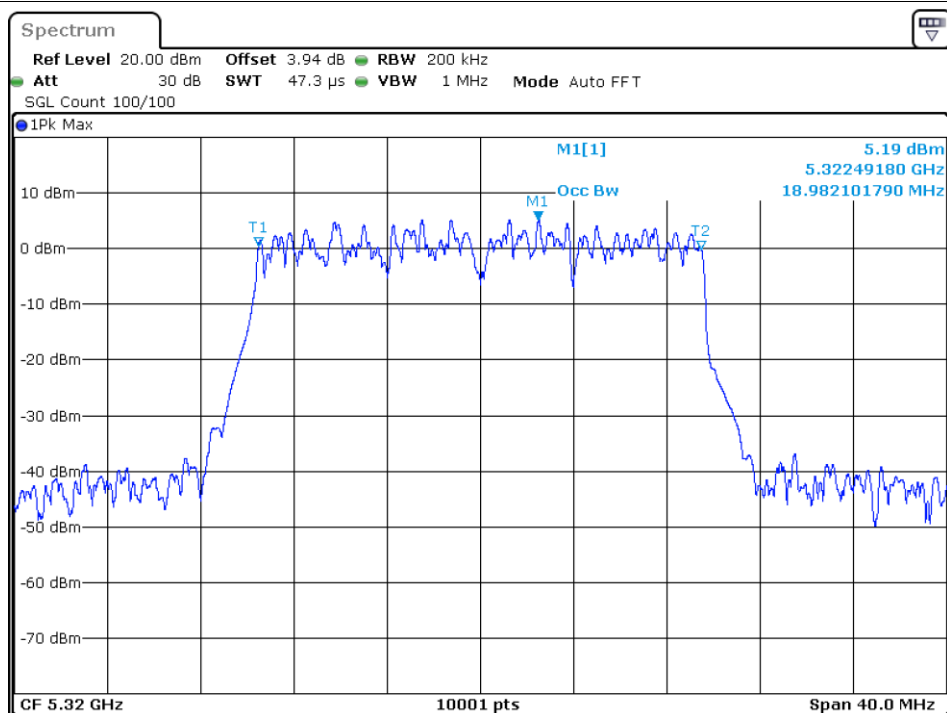


OBW NVNT ax20 5320MHz Ant1

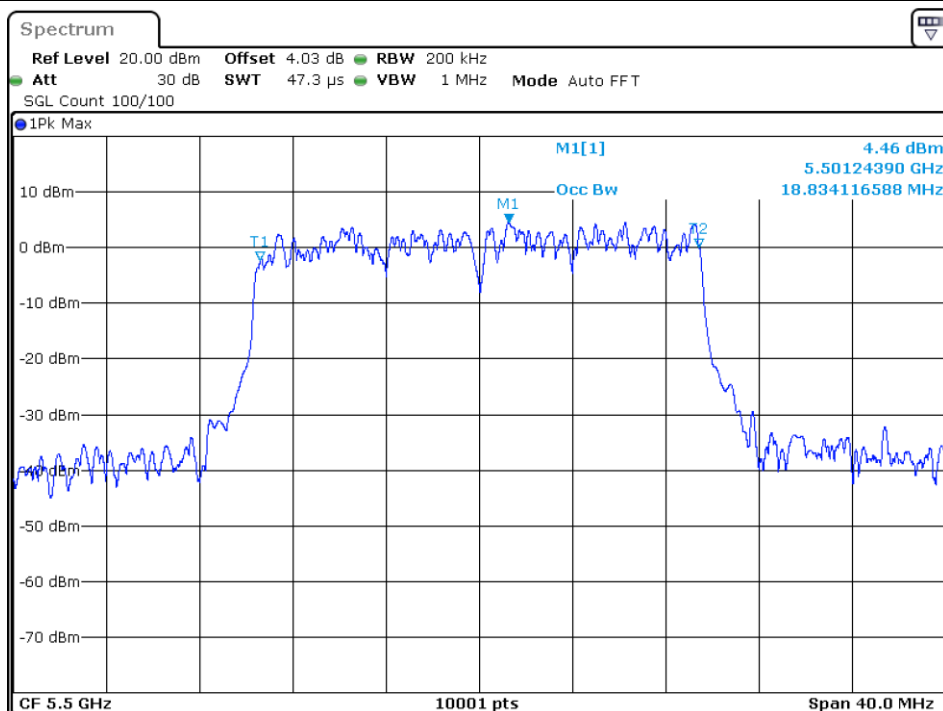


OBW NVNT ax20 5500MHz Ant1

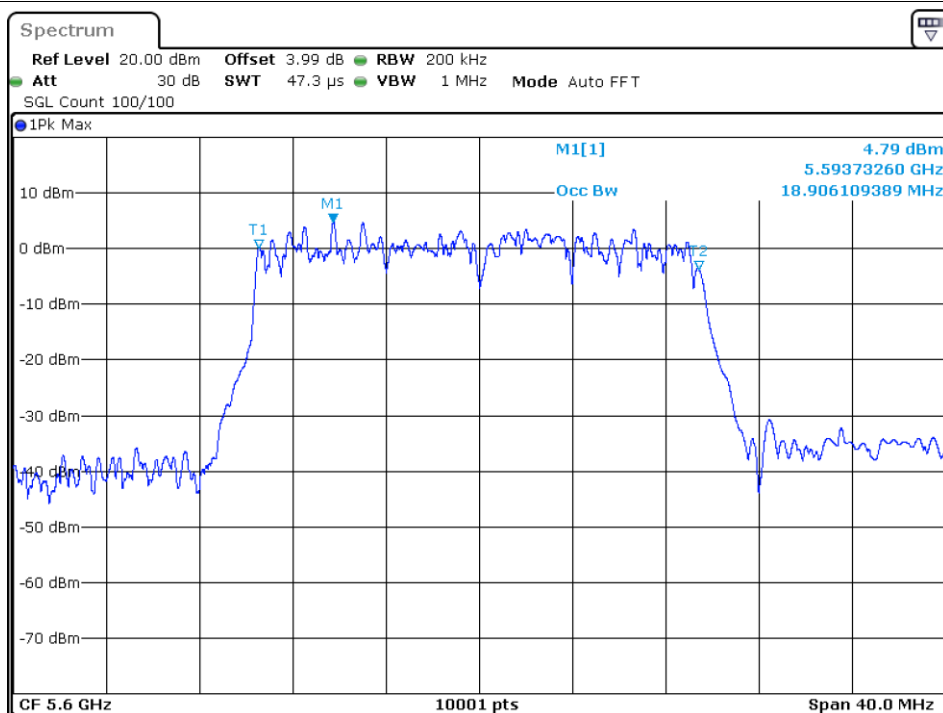


OBW NVNT ax20 5600MHz Ant1

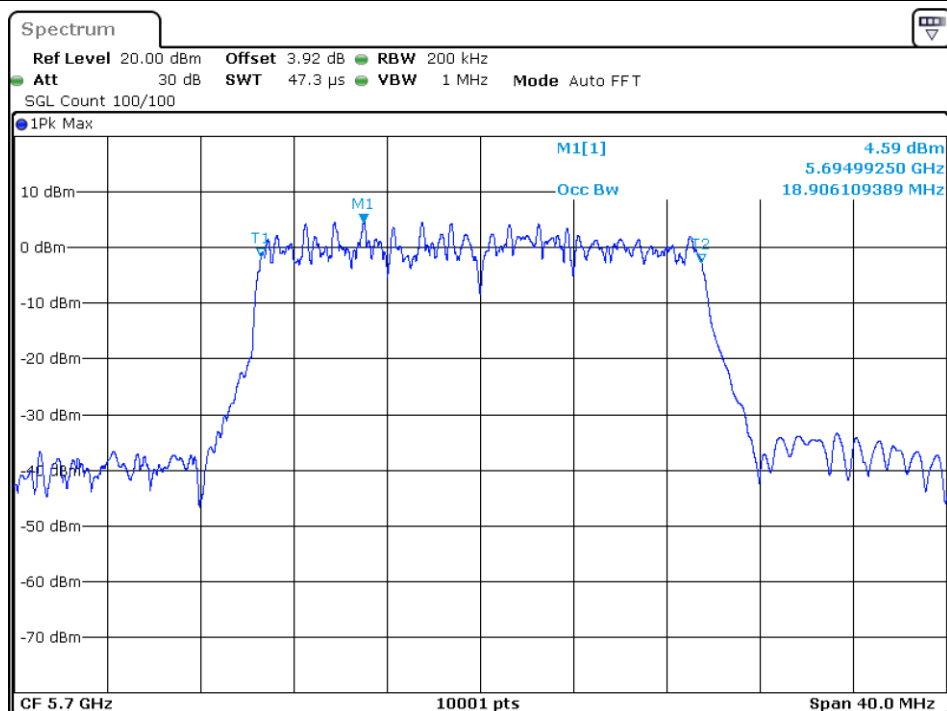


OBW NVNT ax20 5700MHz Ant1

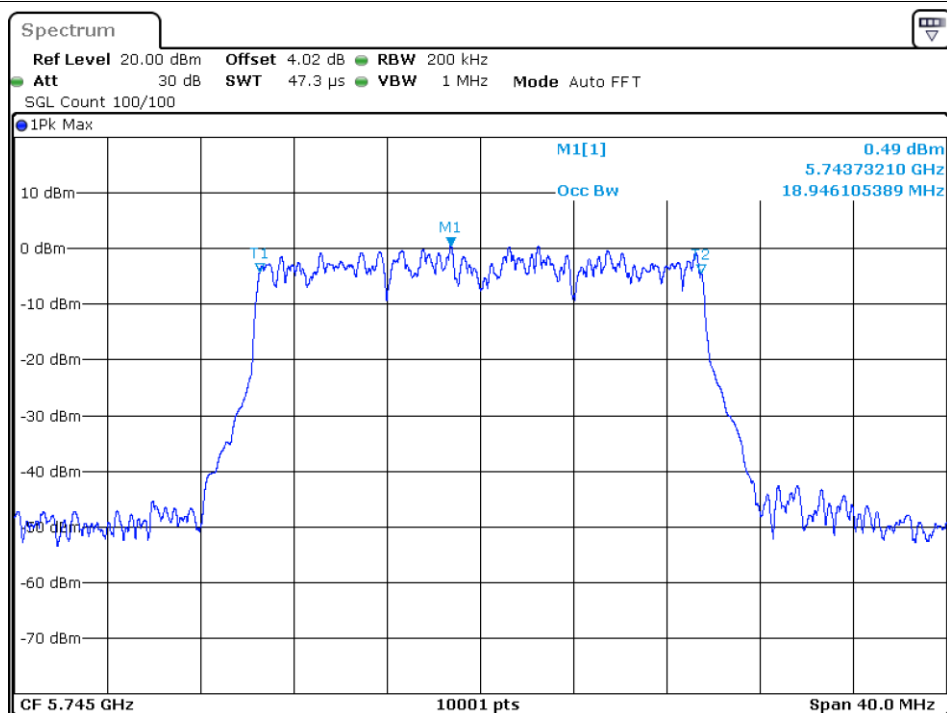

OBW NVNT ax20 5745MHz Ant1

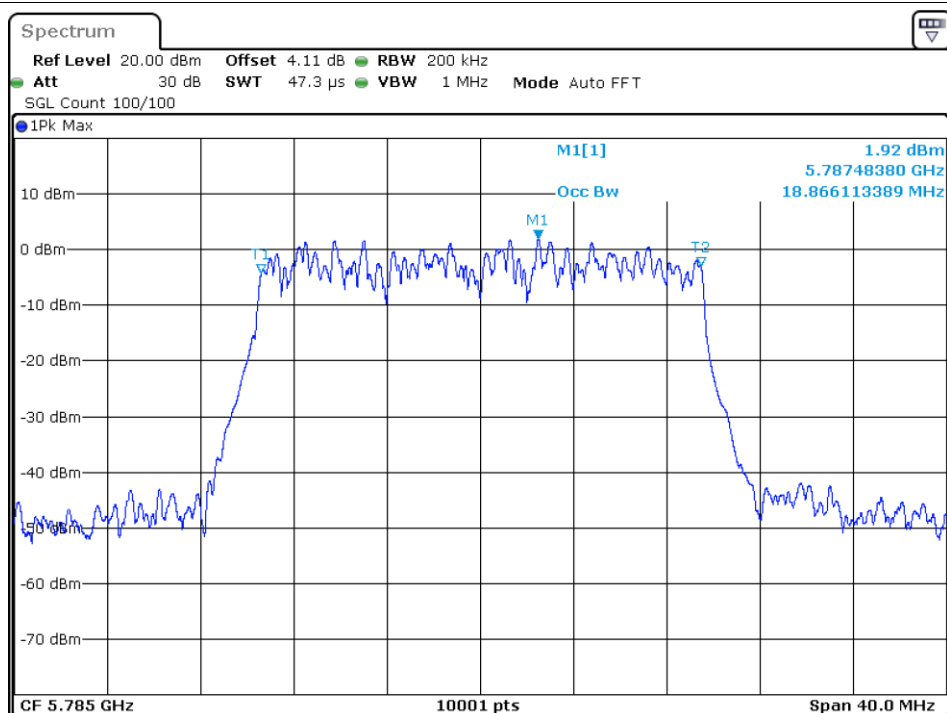

OBW NVNT ax20 5785MHz Ant1

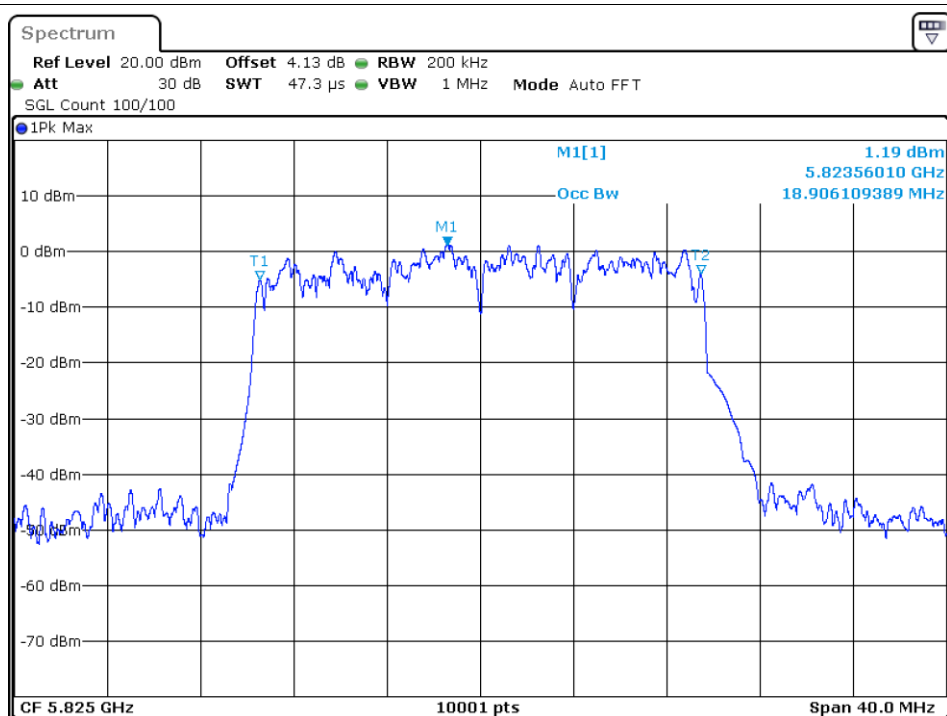


OBW NVNT ax20 5825MHz Ant1


Appendix D Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total Conducted PSD (dBm)	Limit Conducted(dBm)	Verdict
NVNT	a	5180	Ant1	-0.28	2.34	2.06	11	Pass
NVNT	a	5200	Ant1	-0.32	2.34	2.02	11	Pass
NVNT	a	5240	Ant1	-0.22	2.34	2.12	11	Pass
NVNT	a	5260	Ant1	3.62	2.34	5.96	11	Pass
NVNT	a	5280	Ant1	3.62	2.35	5.97	11	Pass
NVNT	a	5320	Ant1	3.71	2.34	6.05	11	Pass
NVNT	a	5500	Ant1	3.93	2.35	6.28	11	Pass
NVNT	a	5600	Ant1	3.39	2.34	5.73	11	Pass
NVNT	a	5700	Ant1	2.74	2.34	5.08	11	Pass
NVNT	a	5745	Ant1	-7.95	2.34	-5.61	30	Pass
NVNT	a	5785	Ant1	-7.48	2.34	-5.14	30	Pass
NVNT	a	5825	Ant1	-7.11	2.34	-4.77	30	Pass
NVNT	n20	5180	Ant1	-1.46	2.11	0.65	11	Pass
NVNT	n20	5200	Ant1	-1.58	2.01	0.43	11	Pass
NVNT	n20	5240	Ant1	-1.87	2.01	0.14	11	Pass
NVNT	n20	5260	Ant1	2.3	2.01	4.31	11	Pass
NVNT	n20	5280	Ant1	2.6	2.01	4.61	11	Pass
NVNT	n20	5320	Ant1	2.34	2.01	4.35	11	Pass
NVNT	n20	5500	Ant1	2.43	2.01	4.44	11	Pass
NVNT	n20	5600	Ant1	2.16	2.01	4.17	11	Pass
NVNT	n20	5700	Ant1	2.09	2.01	4.1	11	Pass
NVNT	n20	5745	Ant1	-7.91	2.01	-5.9	30	Pass
NVNT	n20	5785	Ant1	-7.45	2.01	-5.44	30	Pass
NVNT	n20	5825	Ant1	-7.66	2.11	-5.55	30	Pass
NVNT	ac20	5180	Ant1	-1.63	2.22	0.59	11	Pass
NVNT	ac20	5200	Ant1	-1.78	2.22	0.44	11	Pass
NVNT	ac20	5240	Ant1	-1.73	2.22	0.49	11	Pass
NVNT	ac20	5260	Ant1	2.27	2.22	4.49	11	Pass
NVNT	ac20	5280	Ant1	2.24	2.22	4.46	11	Pass
NVNT	ac20	5320	Ant1	2.33	2.11	4.44	11	Pass
NVNT	ac20	5500	Ant1	2.57	2.11	4.68	11	Pass
NVNT	ac20	5600	Ant1	2.06	2.22	4.28	11	Pass
NVNT	ac20	5700	Ant1	1.78	2.22	4	11	Pass
NVNT	ac20	5745	Ant1	-8.33	2.22	-6.11	30	Pass
NVNT	ac20	5785	Ant1	-7.81	2.11	-5.7	30	Pass
NVNT	ac20	5825	Ant1	-7.77	2.22	-5.55	30	Pass
NVNT	ax20	5180	Ant1	-6.6	10.08	3.48	11	Pass
NVNT	ax20	5200	Ant1	-6.38	9.7	3.32	11	Pass
NVNT	ax20	5240	Ant1	-7.3	9.7	2.4	11	Pass


NVNT	ax20	5260	Ant1	-3.28	9.7	6.42	11	Pass
NVNT	ax20	5280	Ant1	-4.57	9.7	5.13	11	Pass
NVNT	ax20	5320	Ant1	-3.84	9.7	5.86	11	Pass
NVNT	ax20	5500	Ant1	-3.26	9.7	6.44	11	Pass
NVNT	ax20	5600	Ant1	-4.13	9.7	5.57	11	Pass
NVNT	ax20	5700	Ant1	-4.19	9.7	5.51	11	Pass
NVNT	ax20	5745	Ant1	-15.67	9.7	-5.97	30	Pass
NVNT	ax20	5785	Ant1	-15.18	9.7	-5.48	30	Pass
NVNT	ax20	5825	Ant1	-15.51	9.7	-5.81	30	Pass

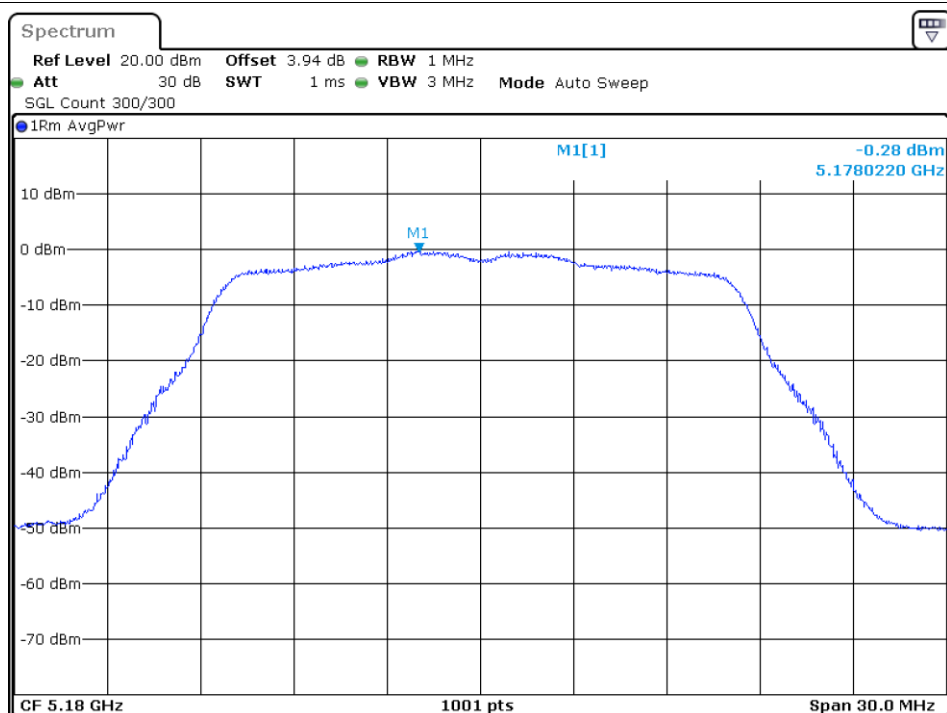


PSD NVNT a 5180MHz Ant1

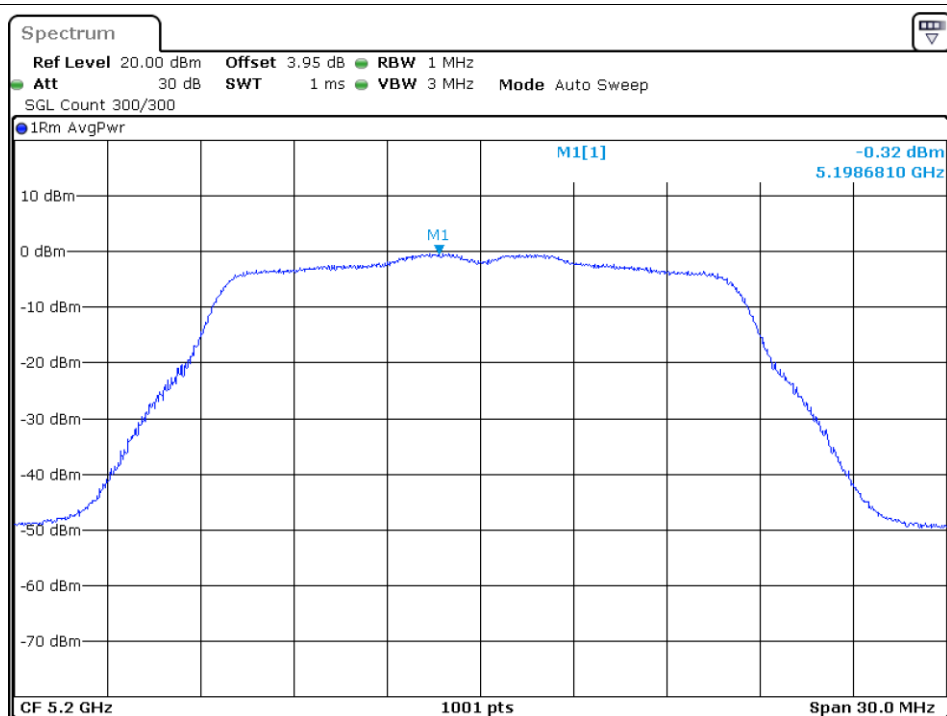


PSD NVNT a 5200MHz Ant1

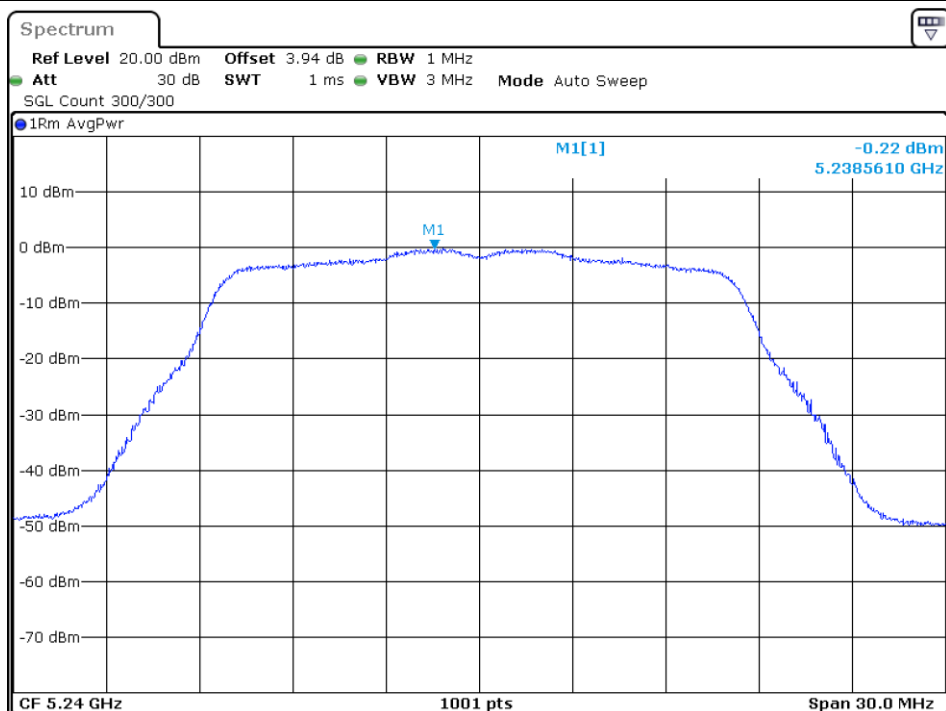


PSD NVNT a 5240MHz Ant1

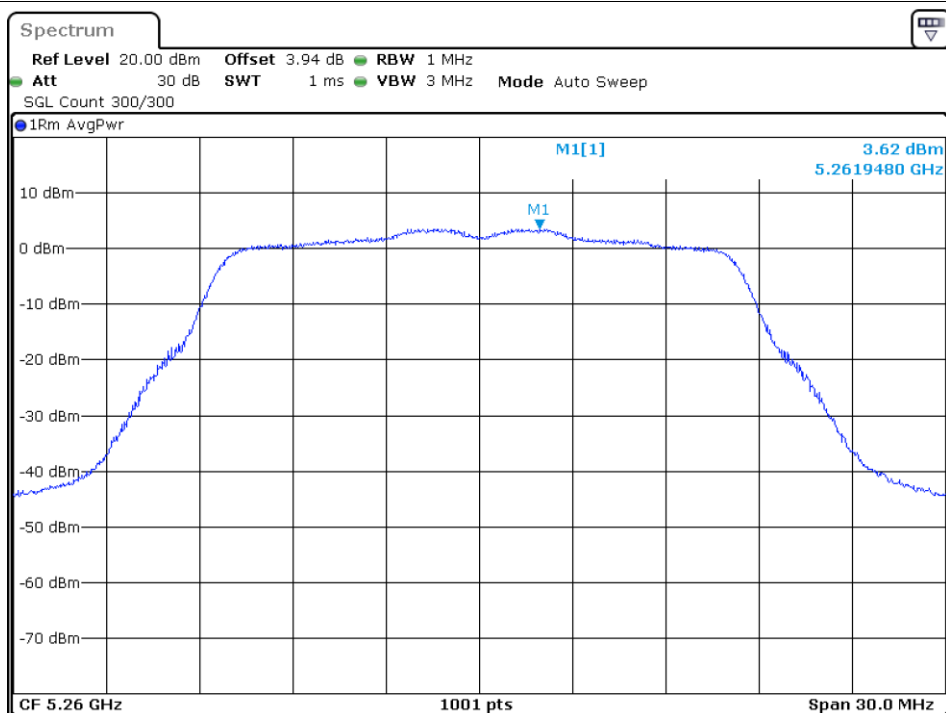


PSD NVNT a 5260MHz Ant1

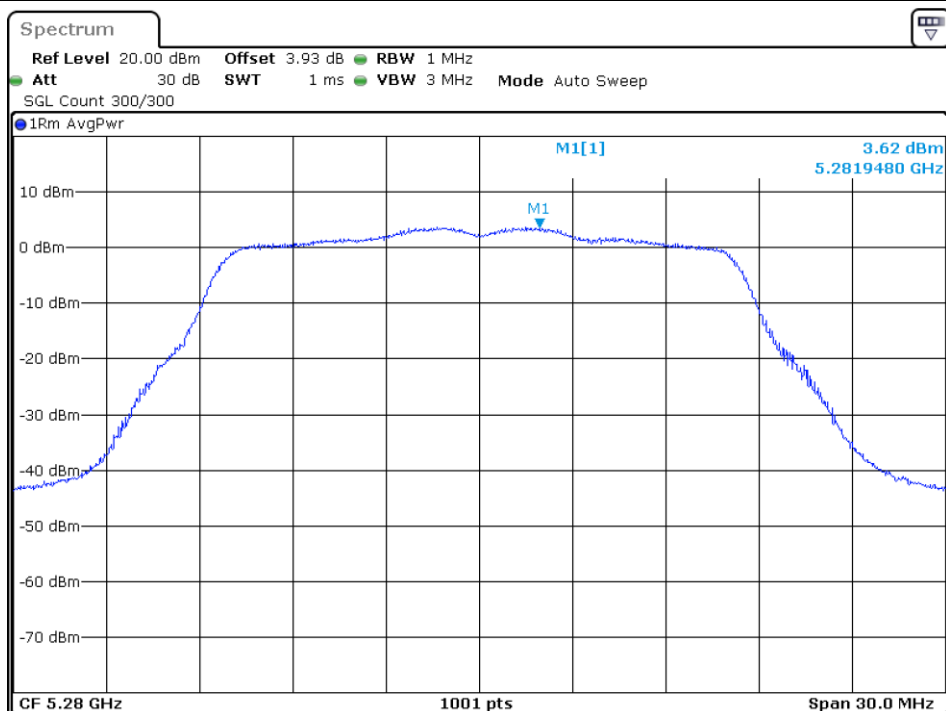


PSD NVNT a 5280MHz Ant1

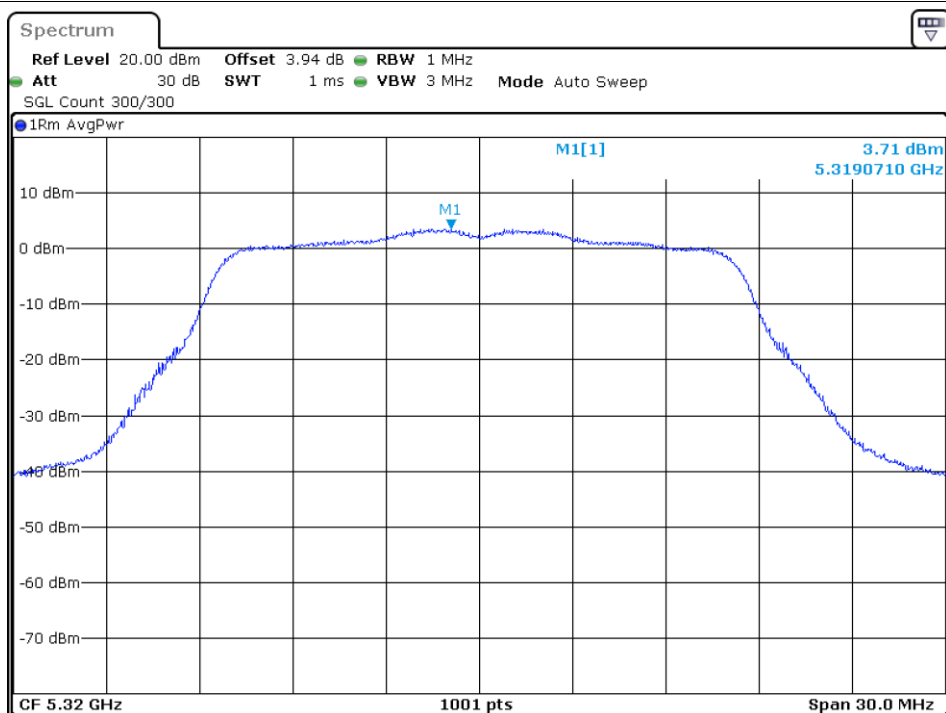


PSD NVNT a 5320MHz Ant1

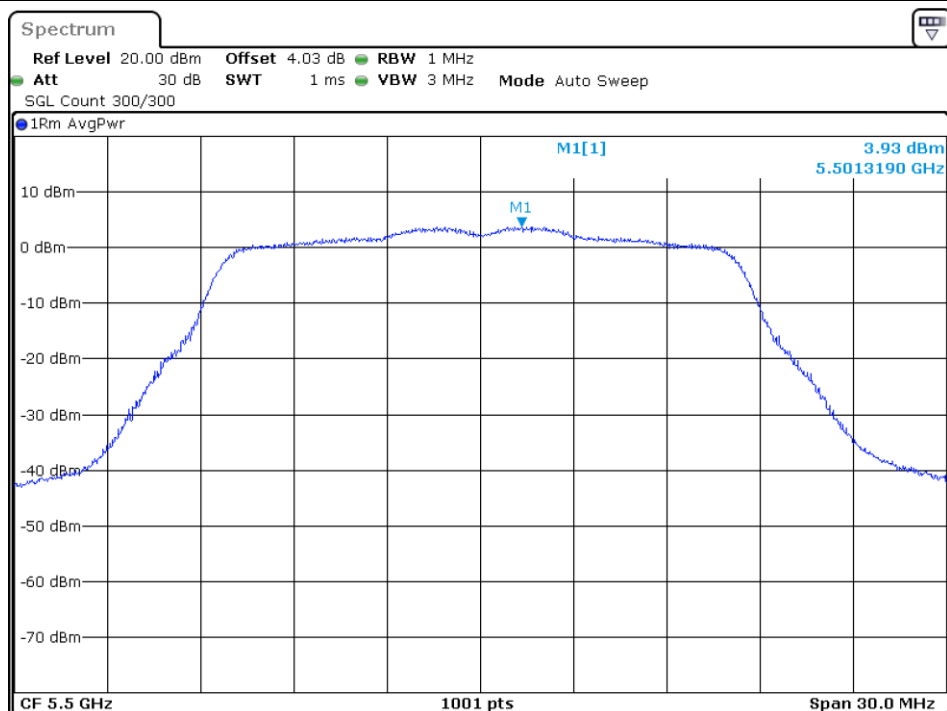


PSD NVNT a 5500MHz Ant1

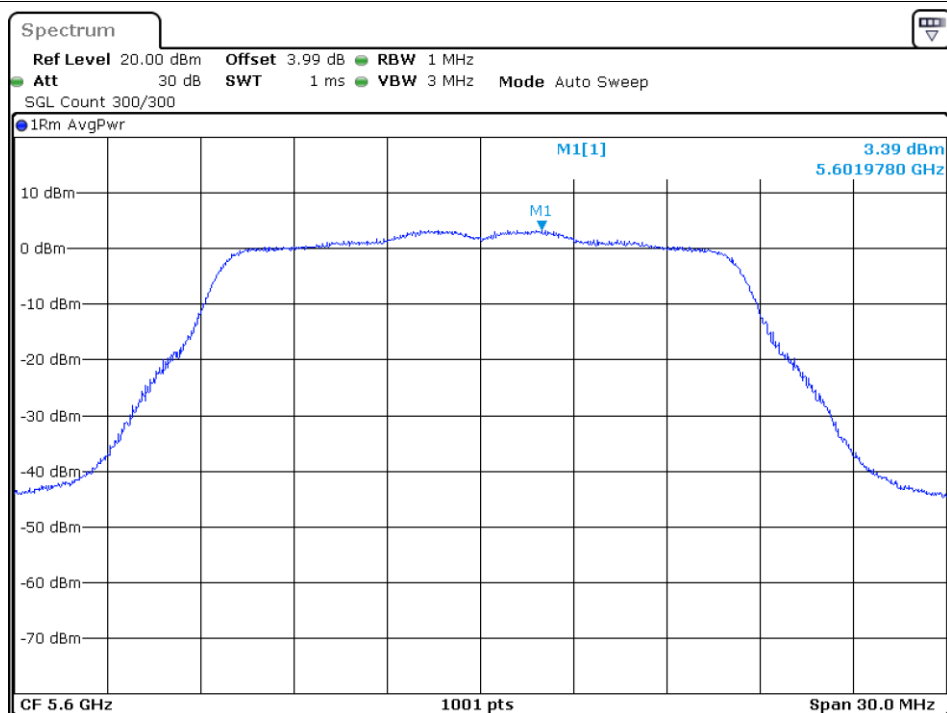


PSD NVNT a 5600MHz Ant1

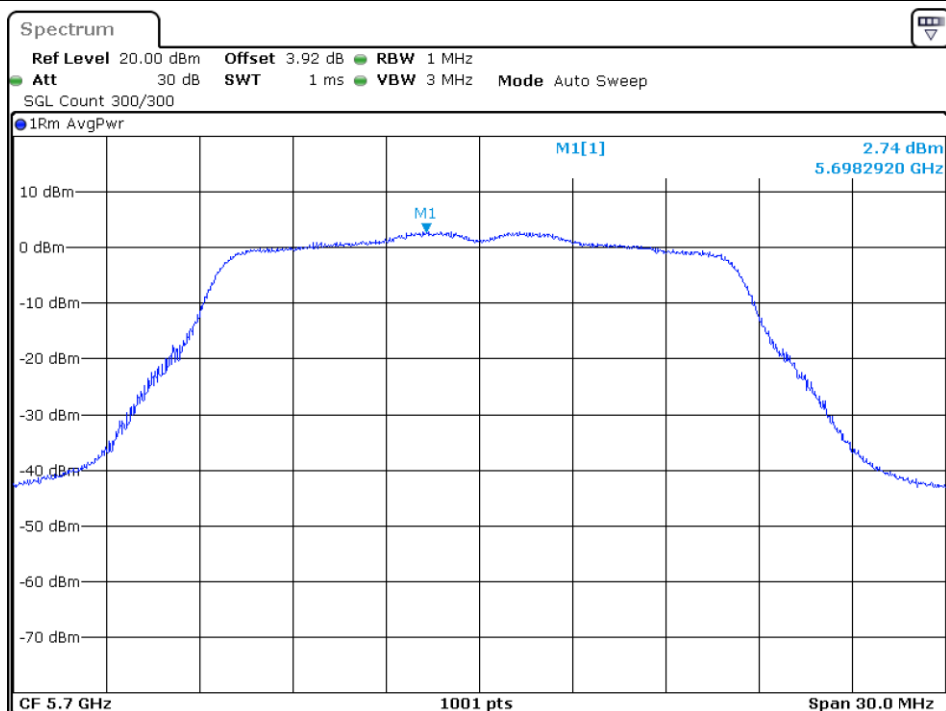


PSD NVNT a 5700MHz Ant1

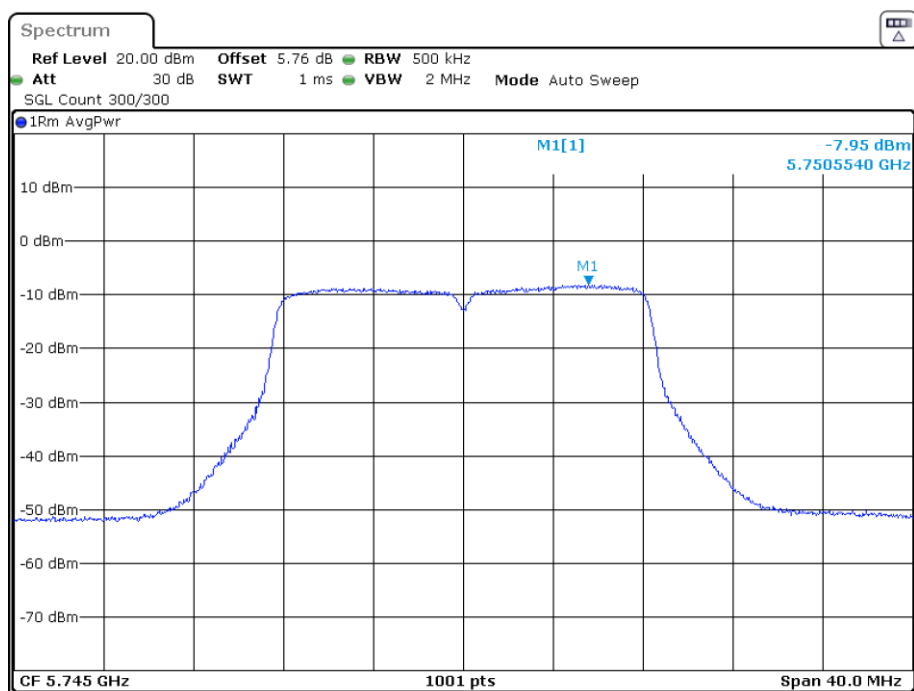


PSD NVNT a 5745MHz Ant1

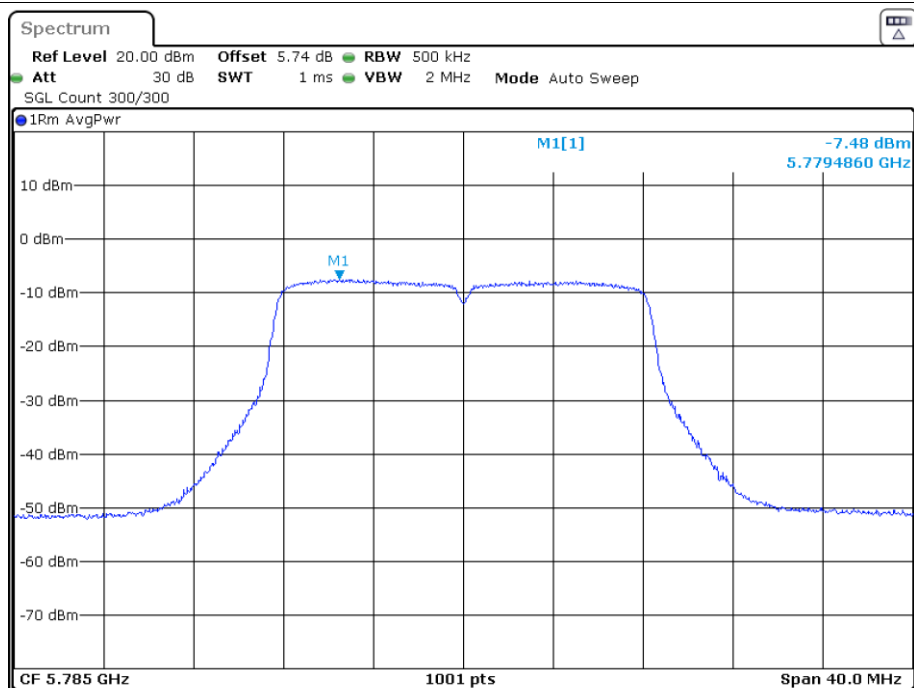


PSD NVNT a 5785MHz Ant1

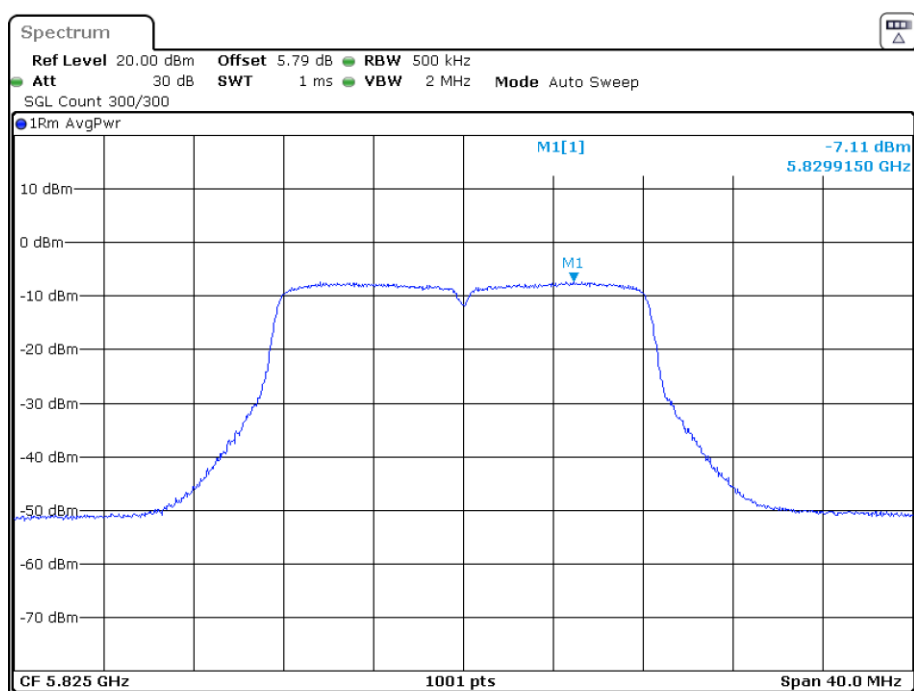


PSD NVNT a 5825MHz Ant1

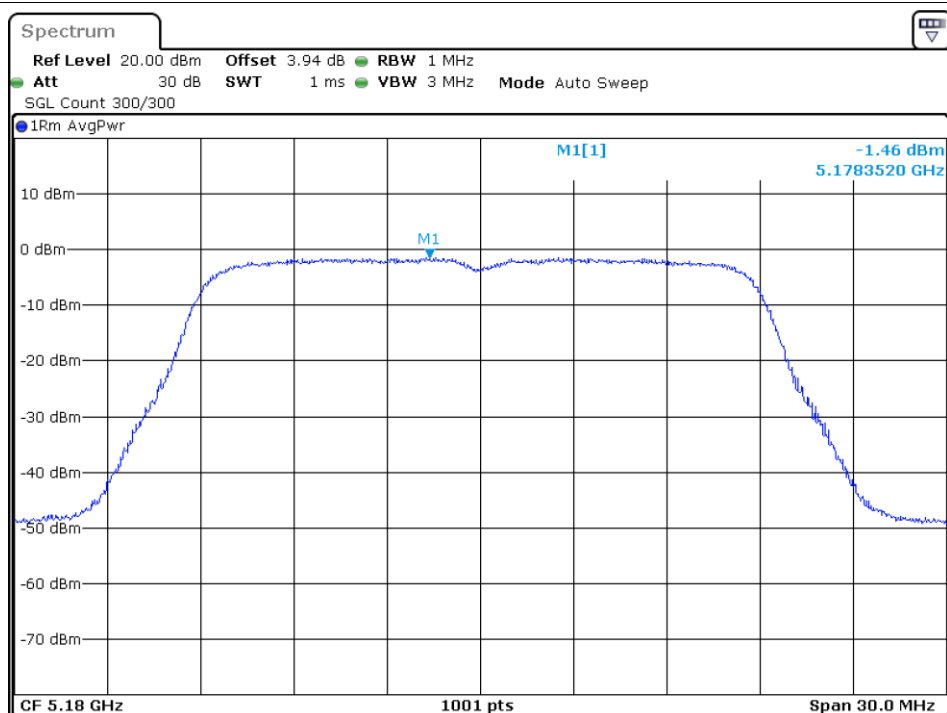


PSD NVNT n20 5180MHz Ant1

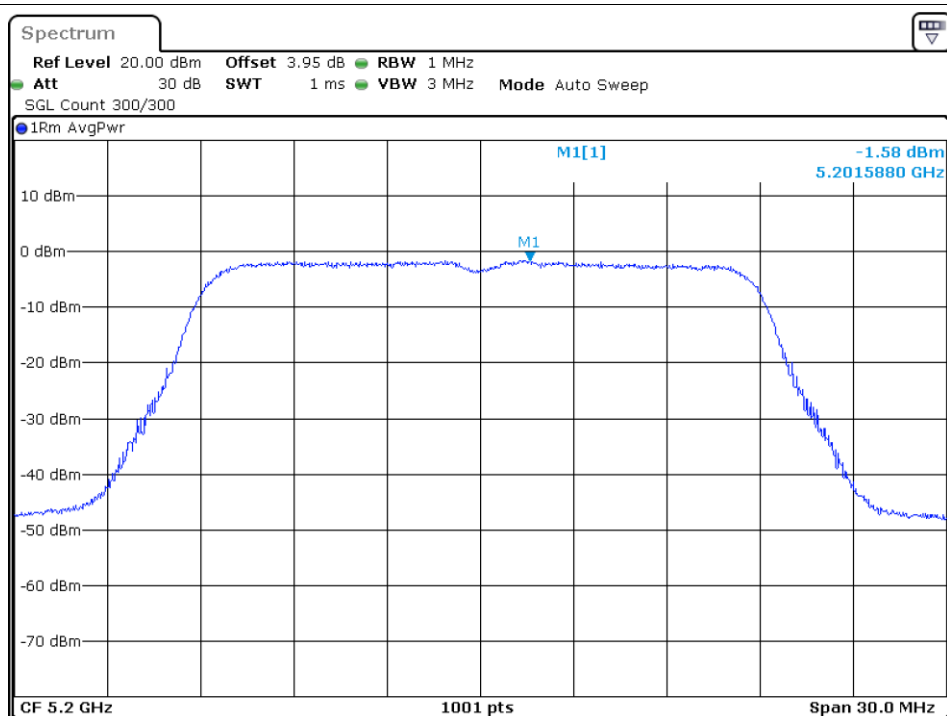


PSD NVNT n20 5200MHz Ant1

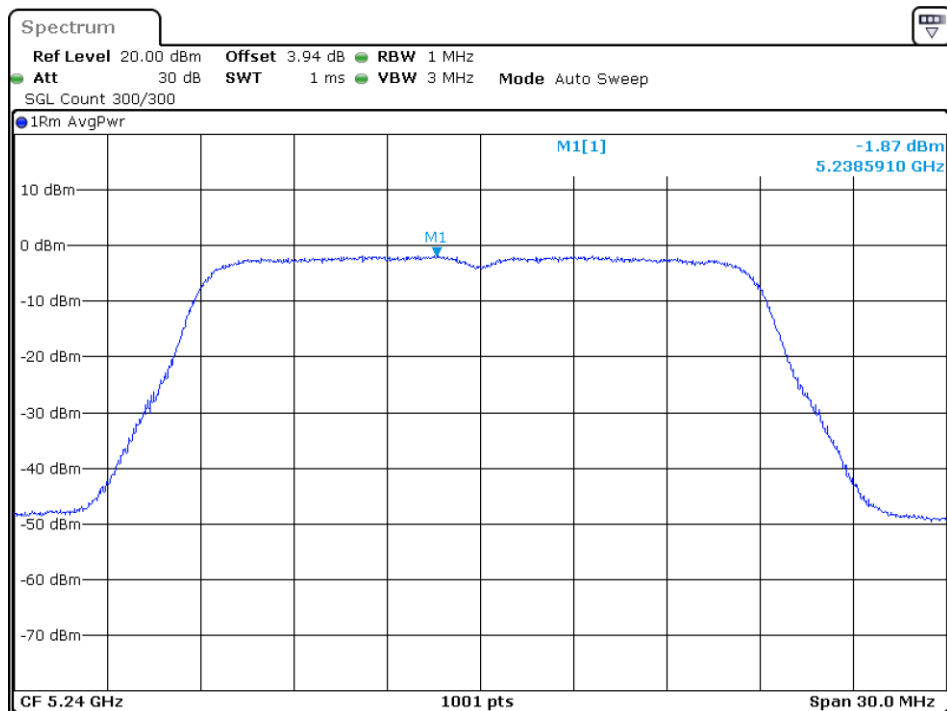


PSD NVNT n20 5240MHz Ant1

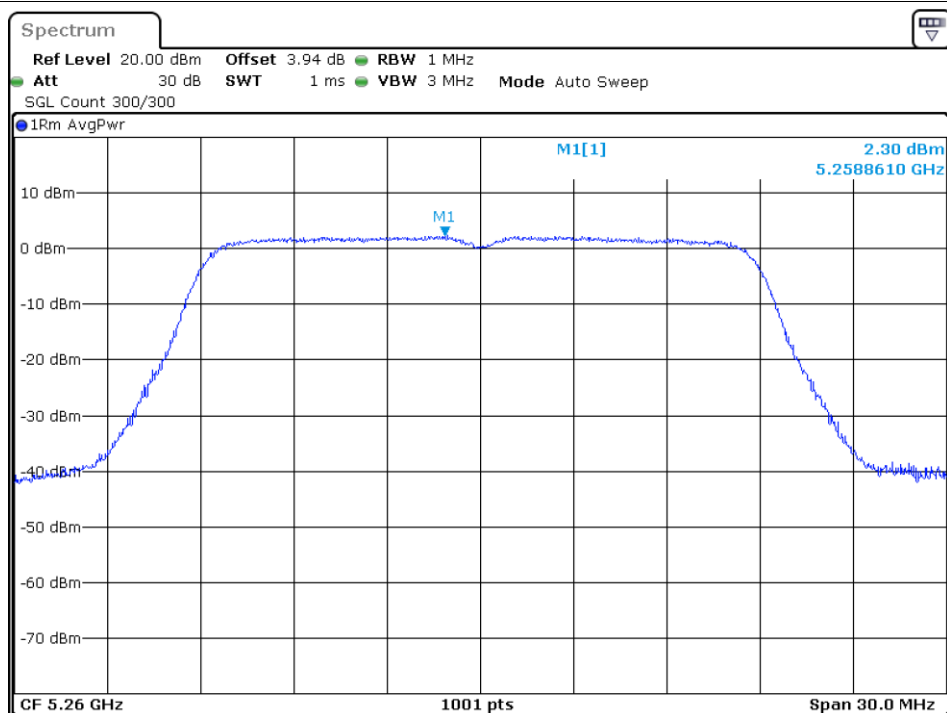


PSD NVNT n20 5260MHz Ant1

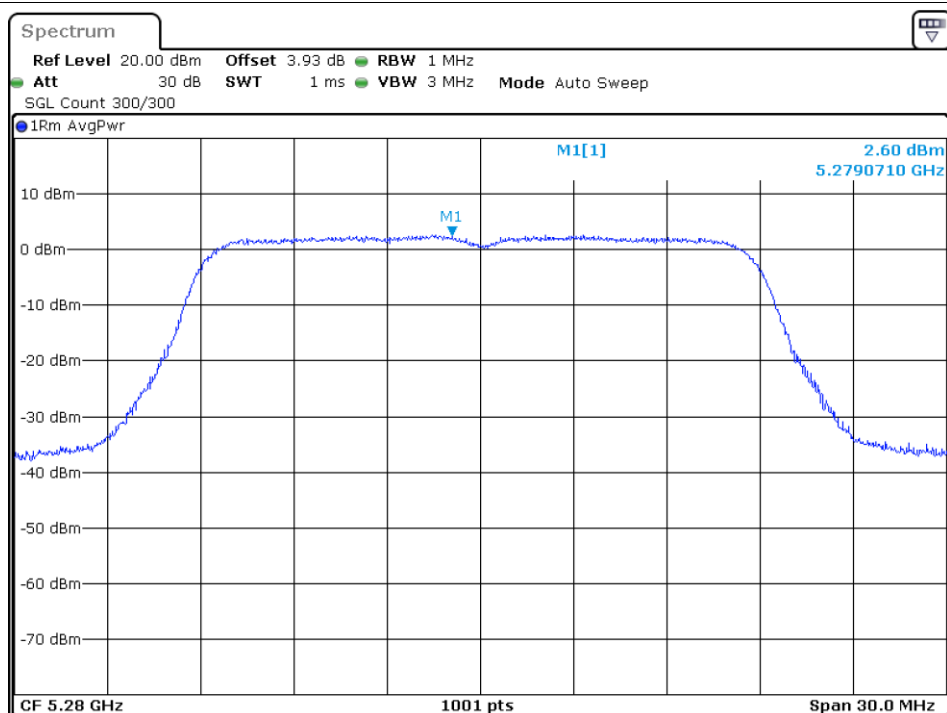


PSD NVNT n20 5280MHz Ant1

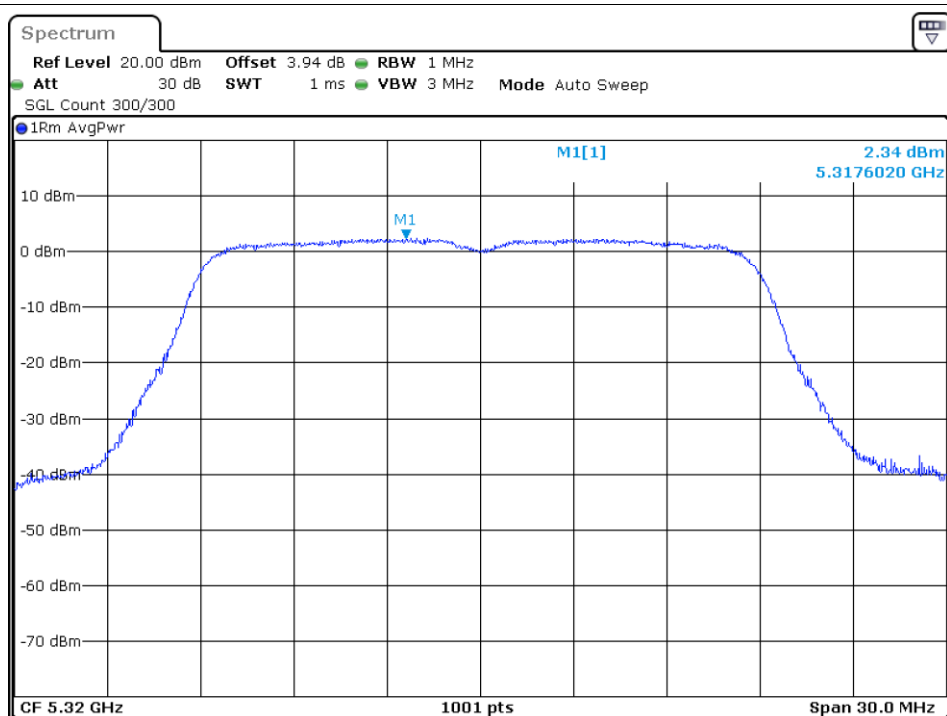


PSD NVNT n20 5320MHz Ant1

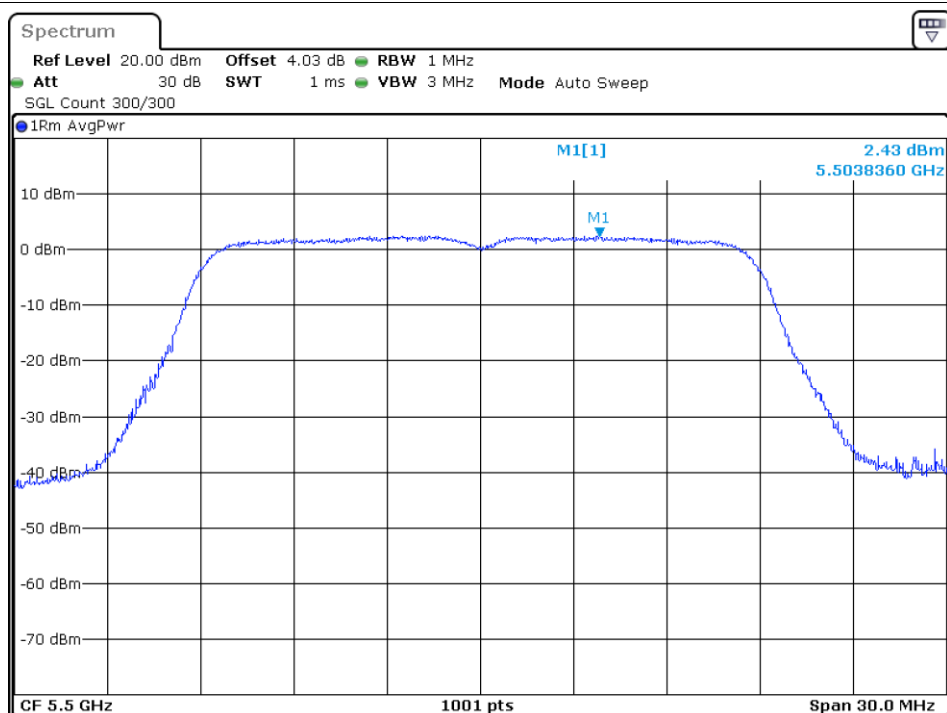


PSD NVNT n20 5500MHz Ant1

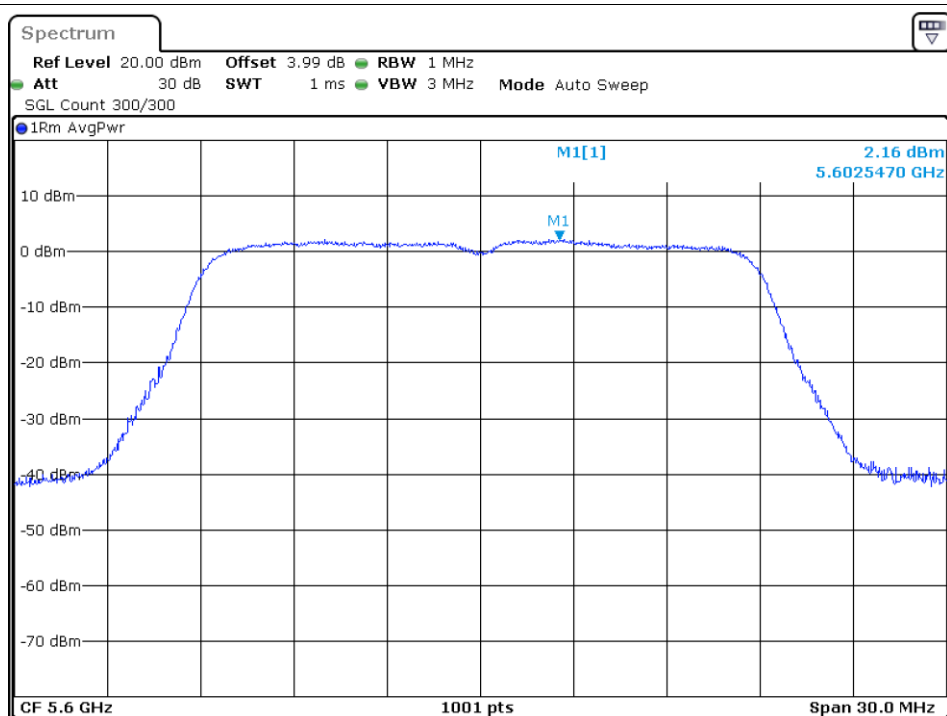


PSD NVNT n20 5600MHz Ant1

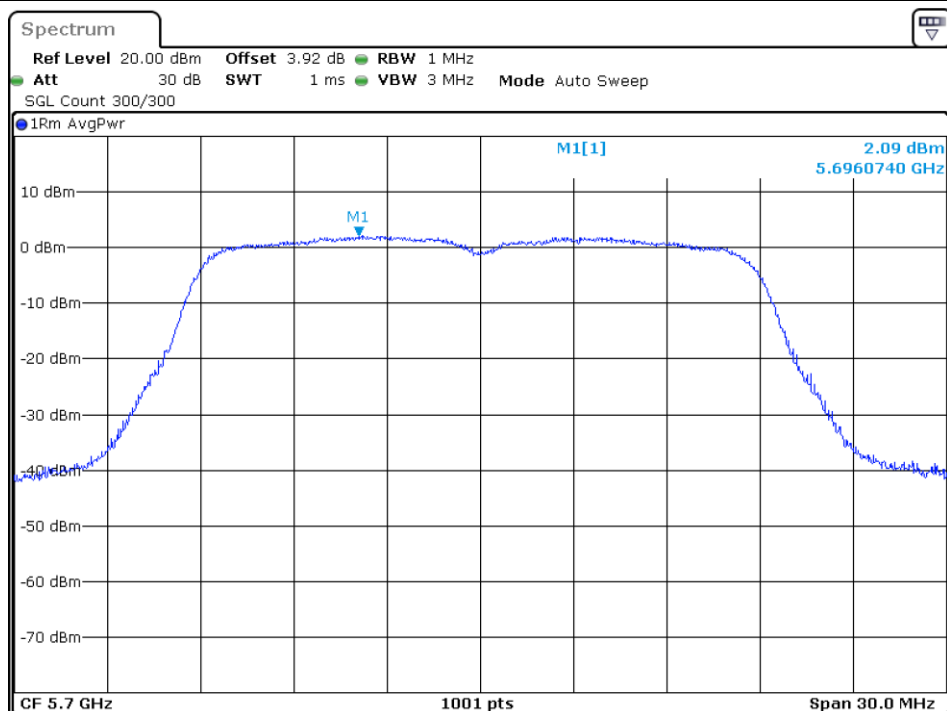


PSD NVNT n20 5700MHz Ant1

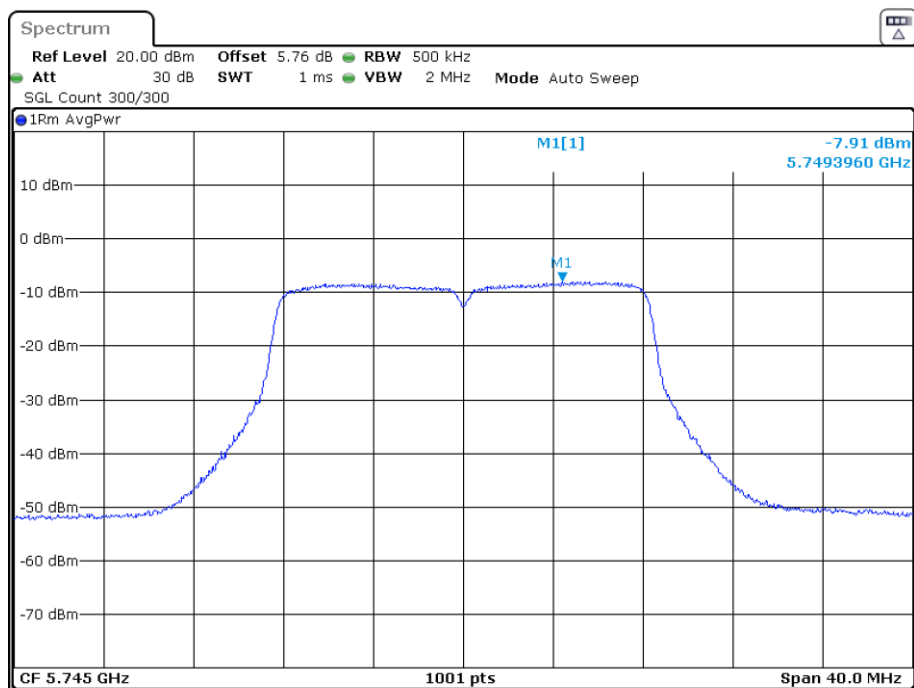


PSD NVNT n20 5745MHz Ant1

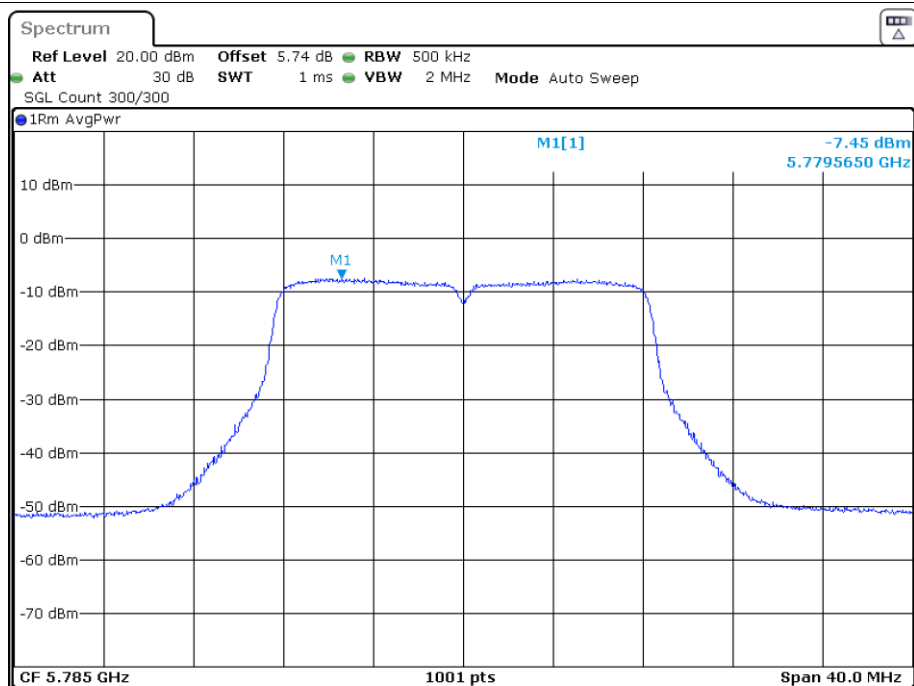


PSD NVNT n20 5785MHz Ant1

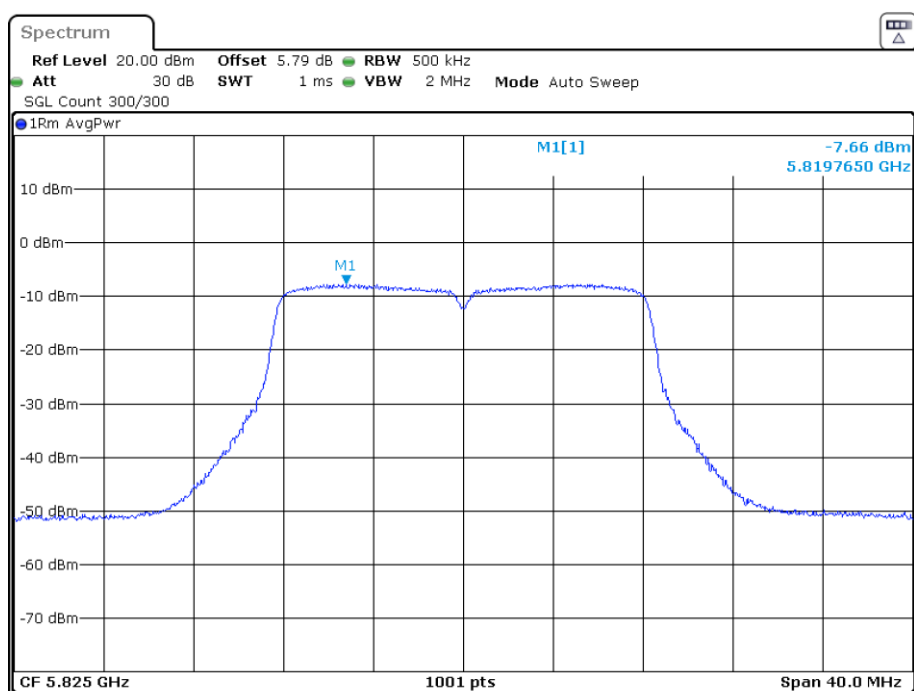


PSD NVNT n20 5825MHz Ant1

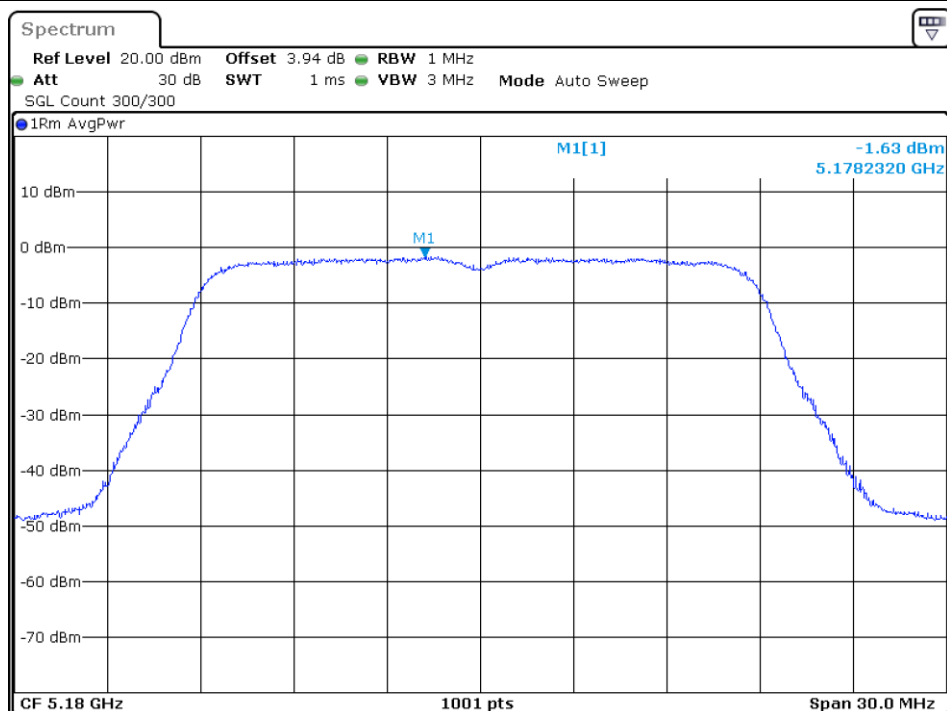


PSD NVNT ac20 5180MHz Ant1

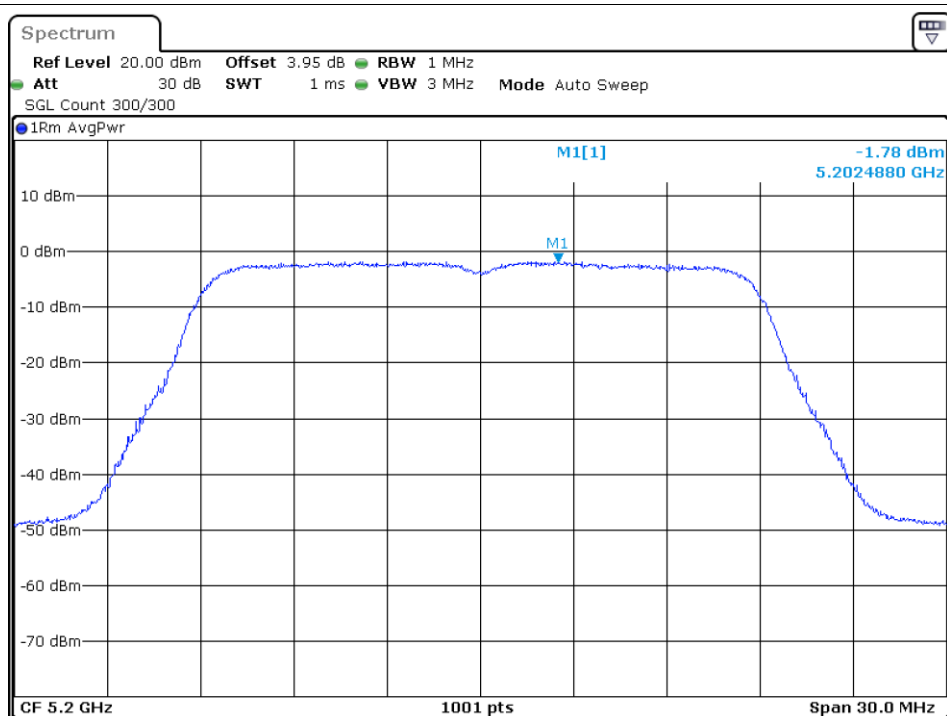


PSD NVNT ac20 5200MHz Ant1

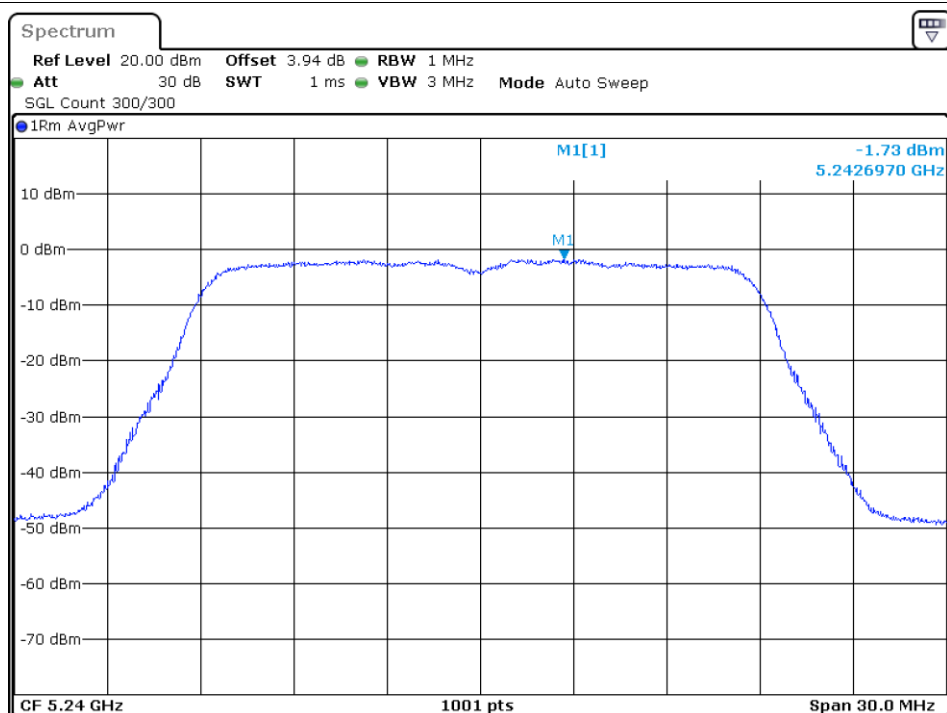


PSD NVNT ac20 5240MHz Ant1

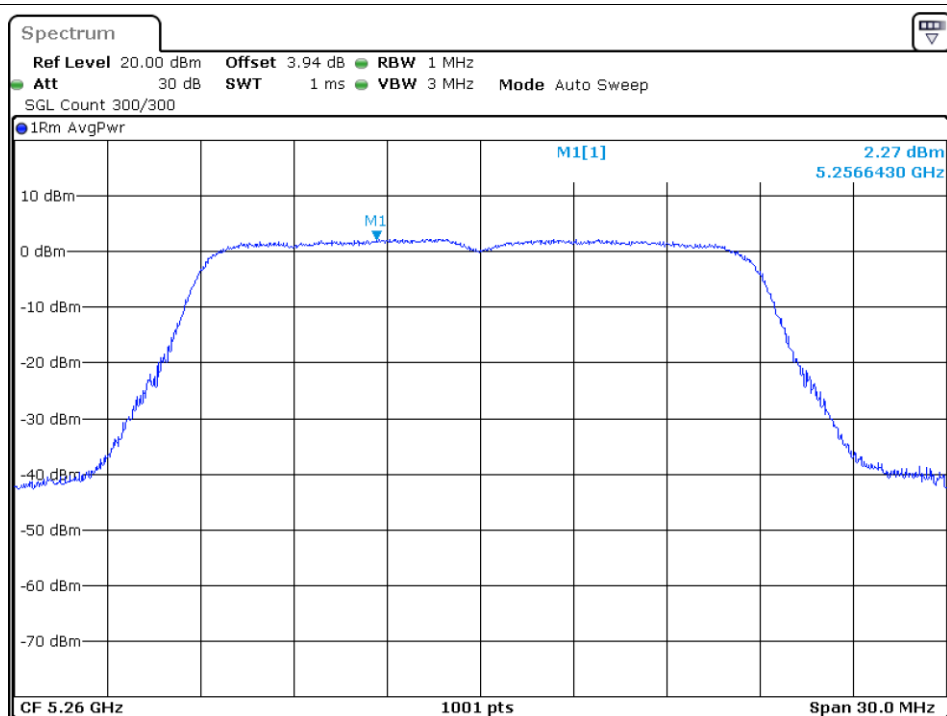


PSD NVNT ac20 5260MHz Ant1

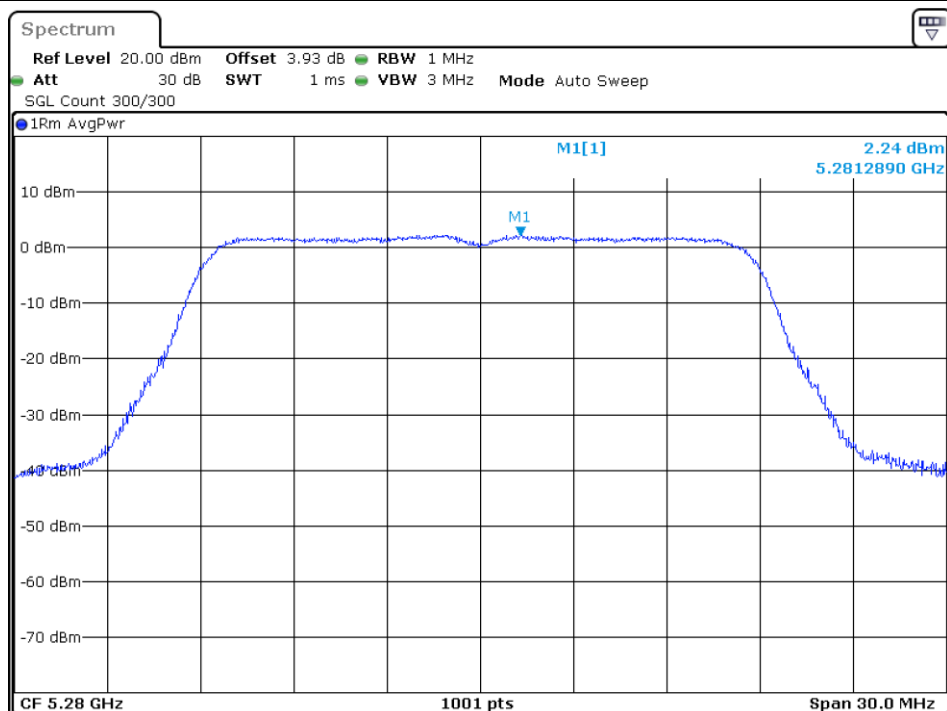


PSD NVNT ac20 5280MHz Ant1

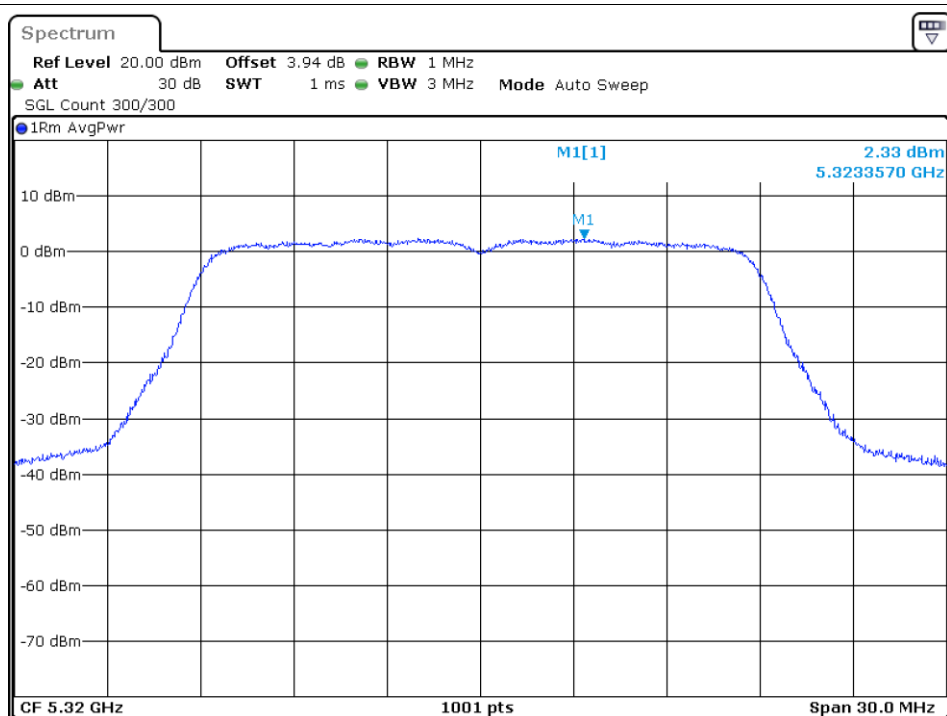


PSD NVNT ac20 5320MHz Ant1

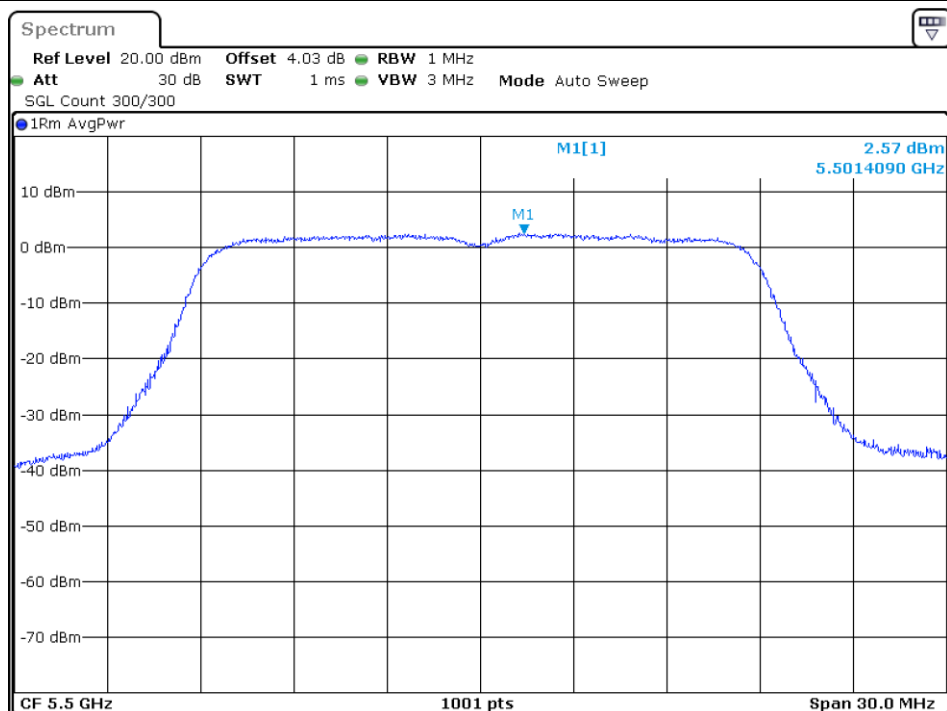


PSD NVNT ac20 5500MHz Ant1

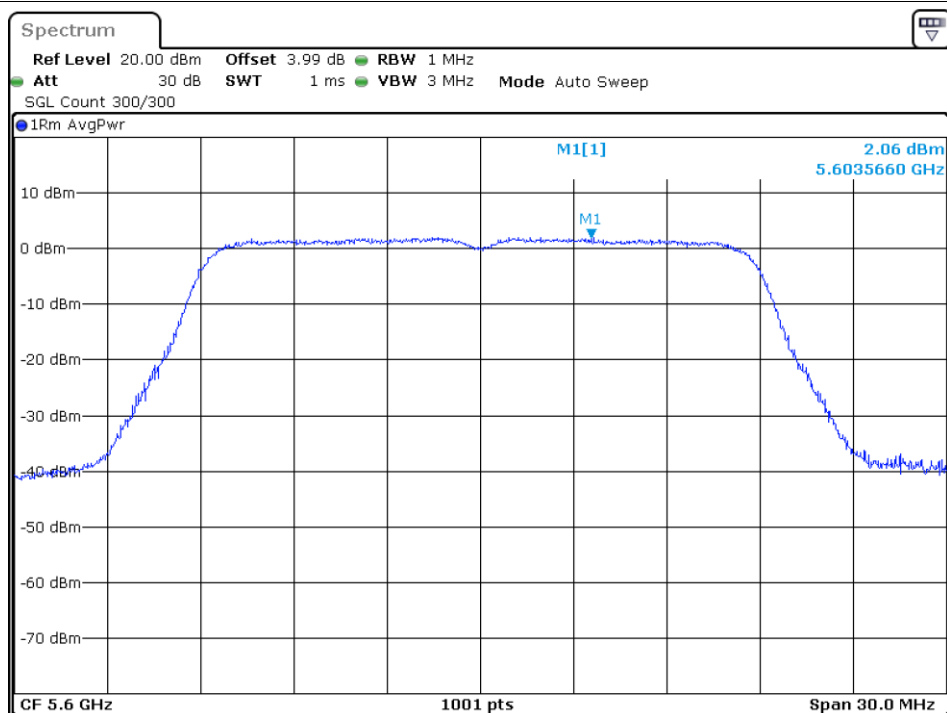


PSD NVNT ac20 5600MHz Ant1

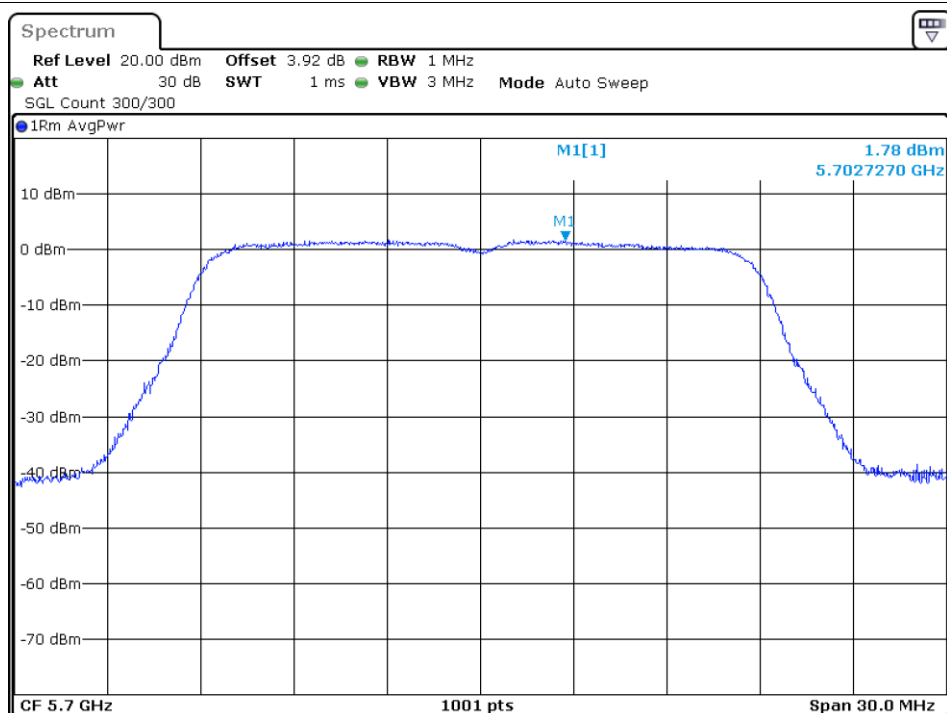


PSD NVNT ac20 5700MHz Ant1

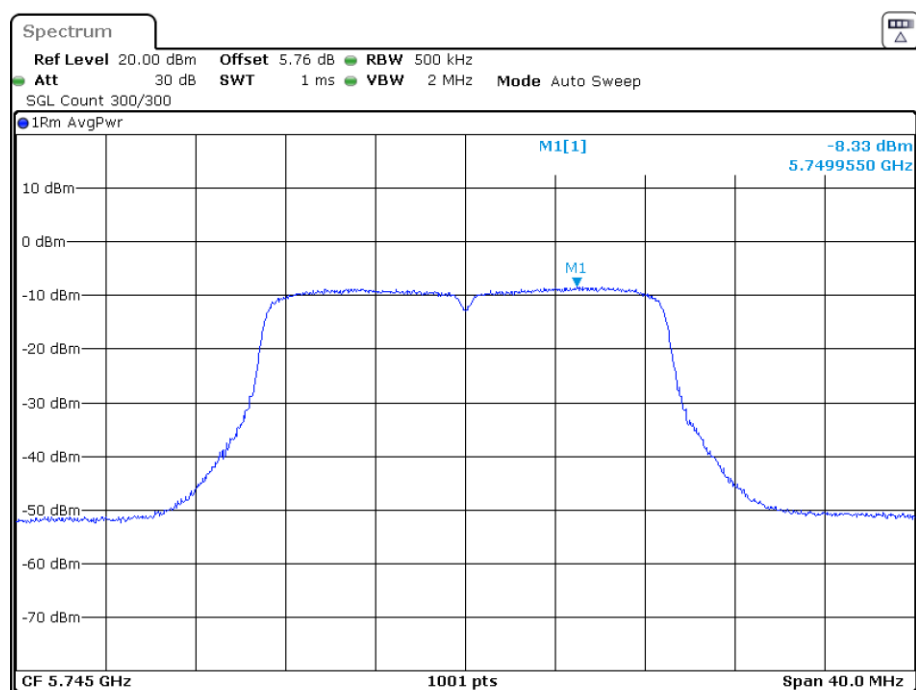


PSD NVNT ac20 5745MHz Ant1

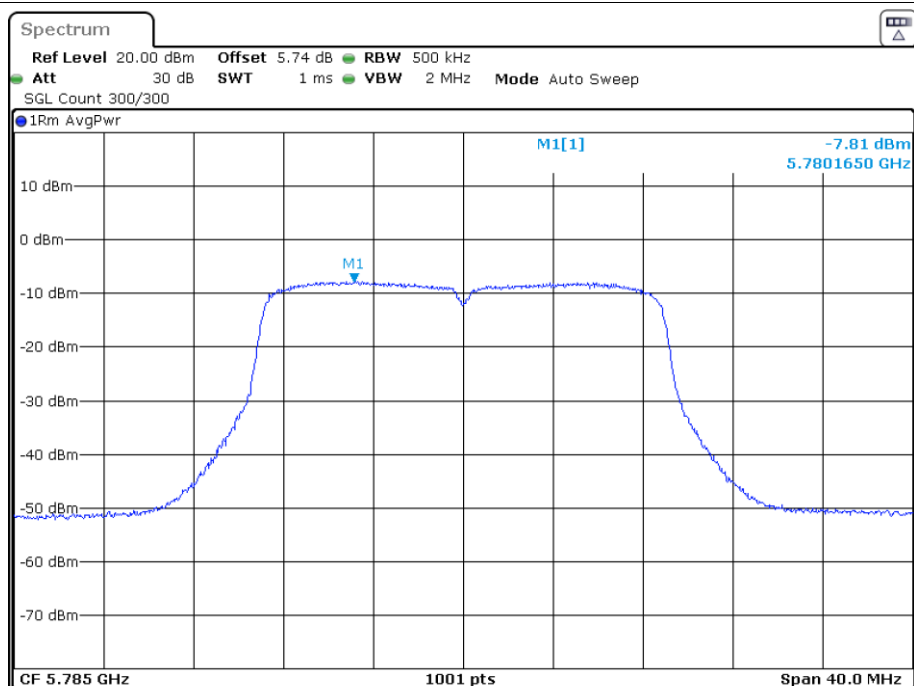


PSD NVNT ac20 5785MHz Ant1

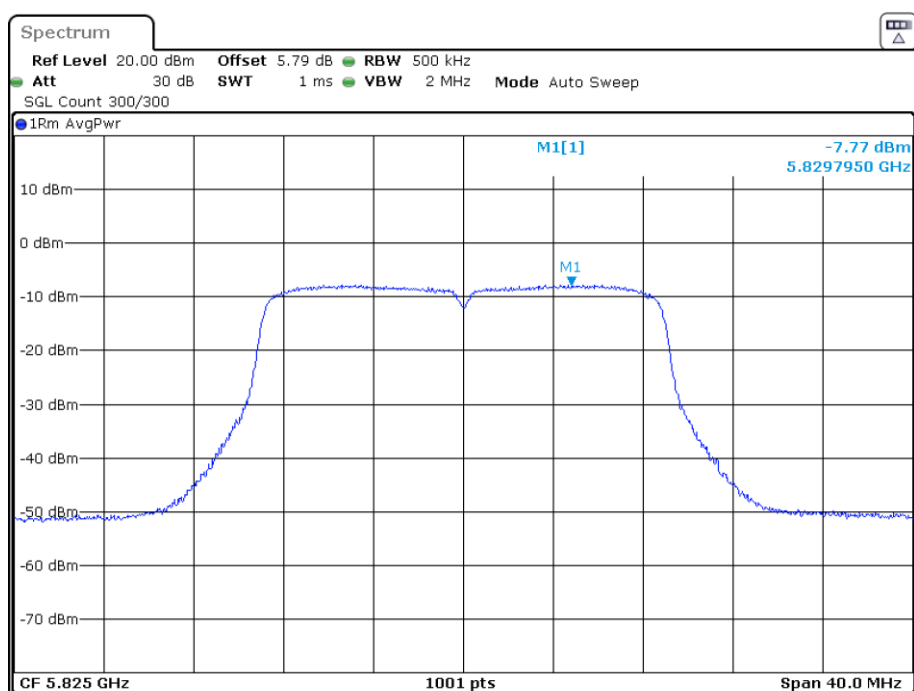


PSD NVNT ac20 5825MHz Ant1

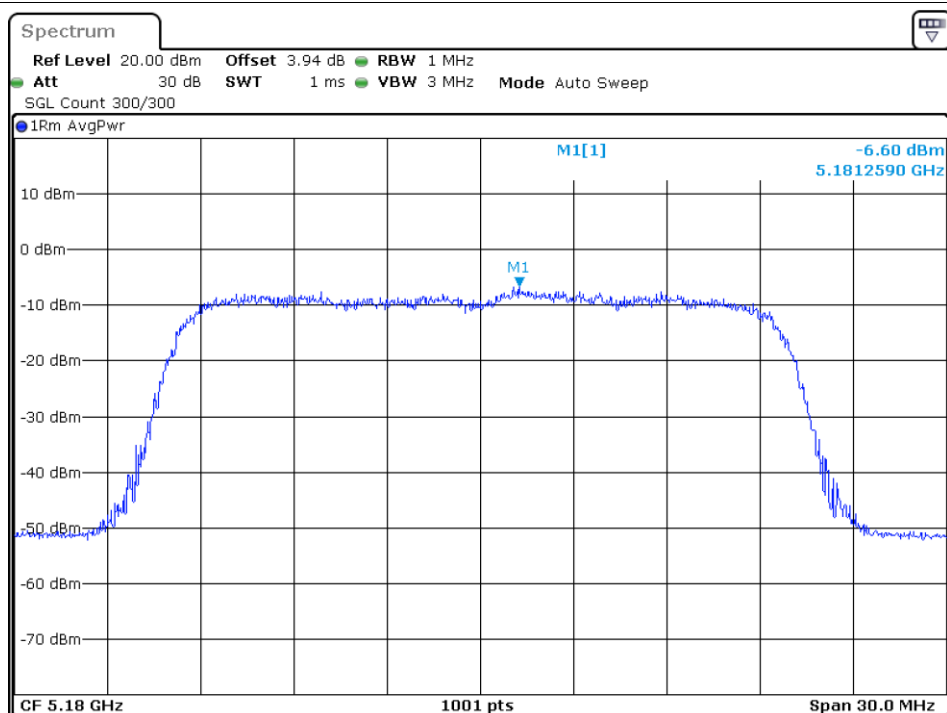


PSD NVNT ax20 5180MHz Ant1

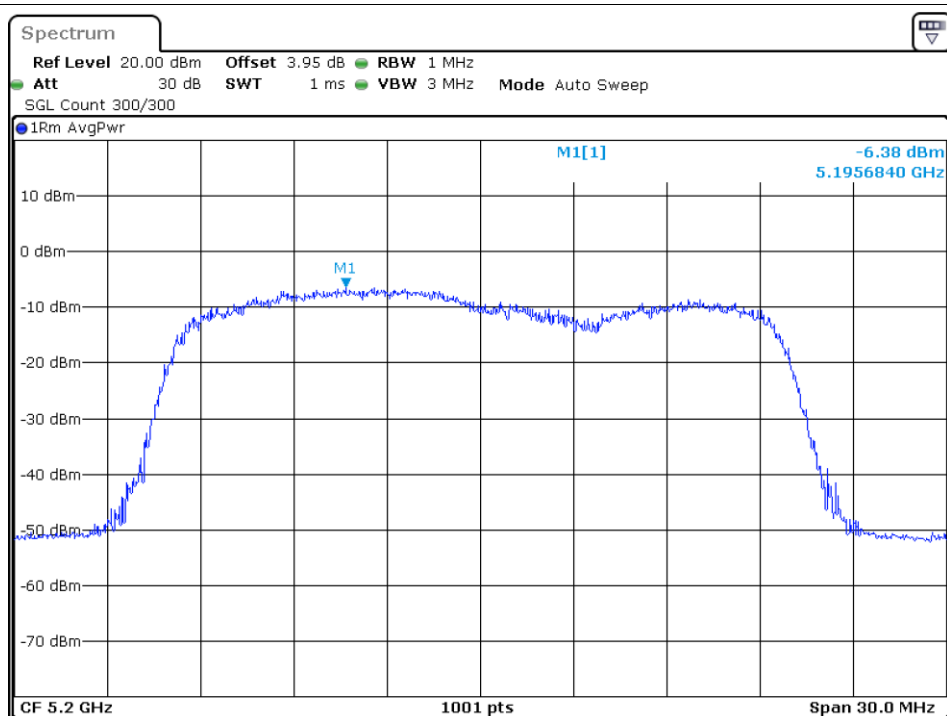


PSD NVNT ax20 5200MHz Ant1

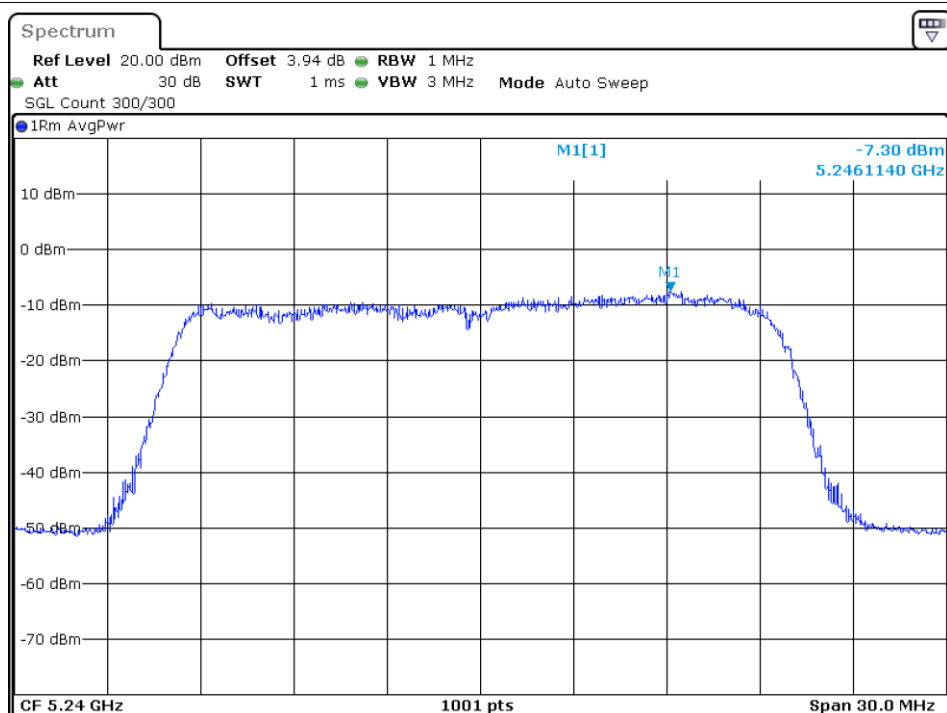


PSD NVNT ax20 5240MHz Ant1

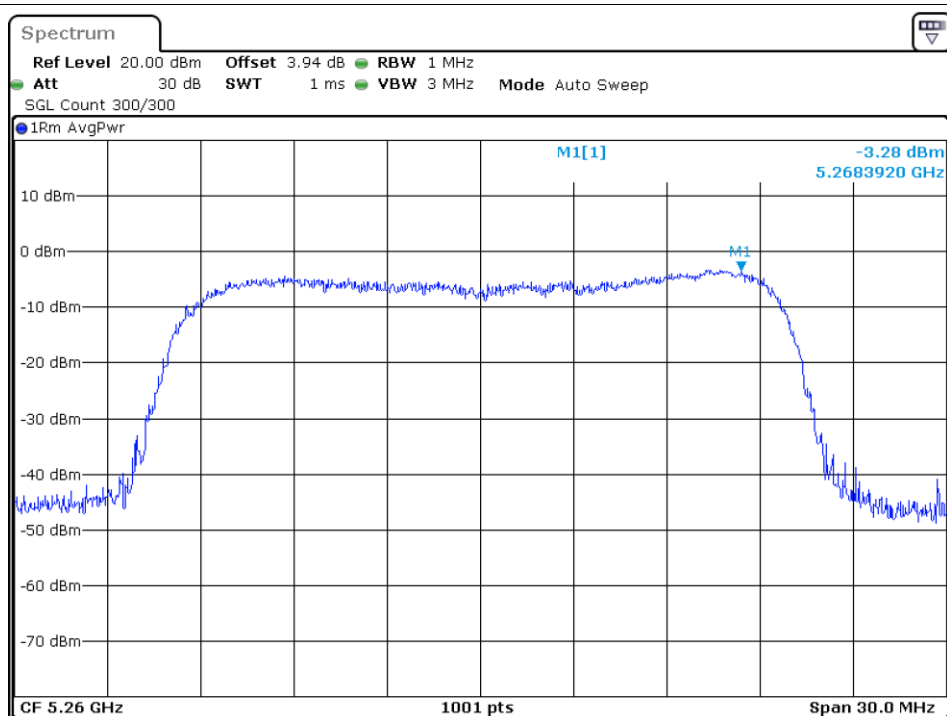


PSD NVNT ax20 5260MHz Ant1

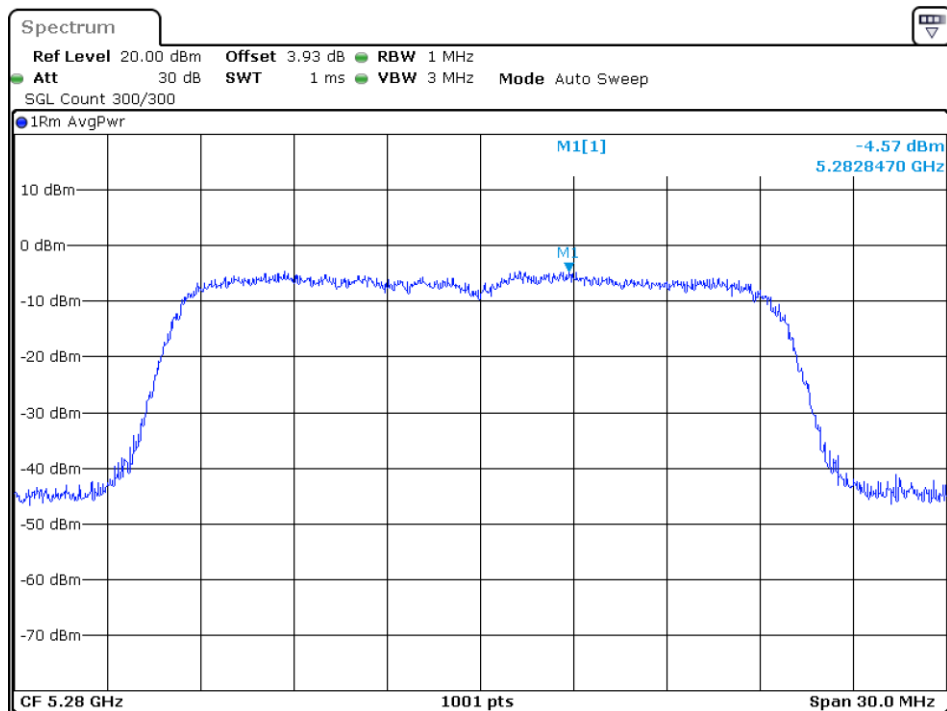


PSD NVNT ax20 5280MHz Ant1

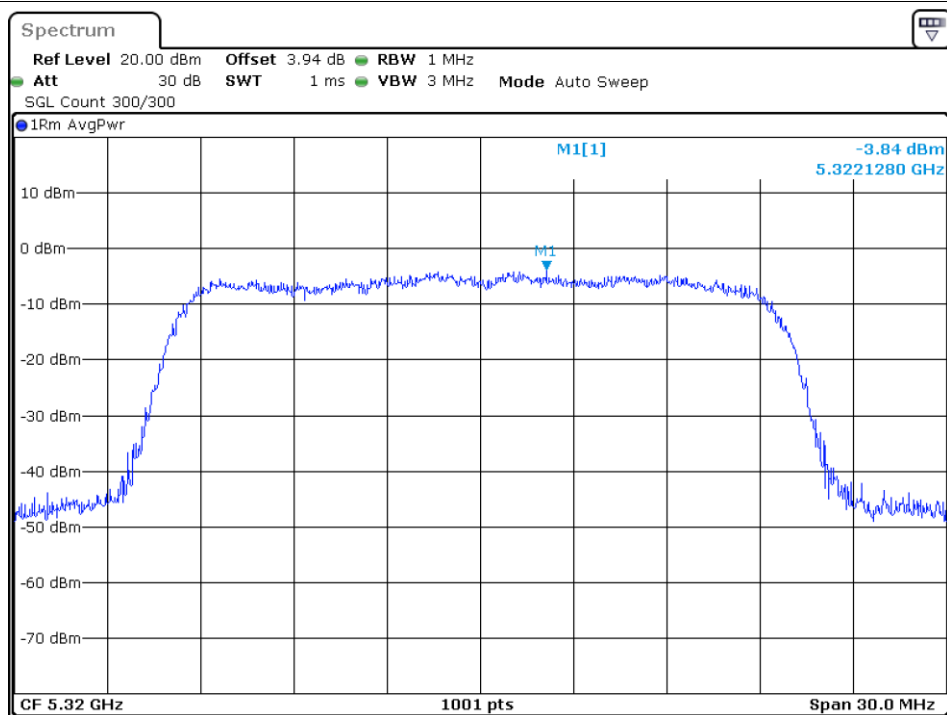


PSD NVNT ax20 5320MHz Ant1

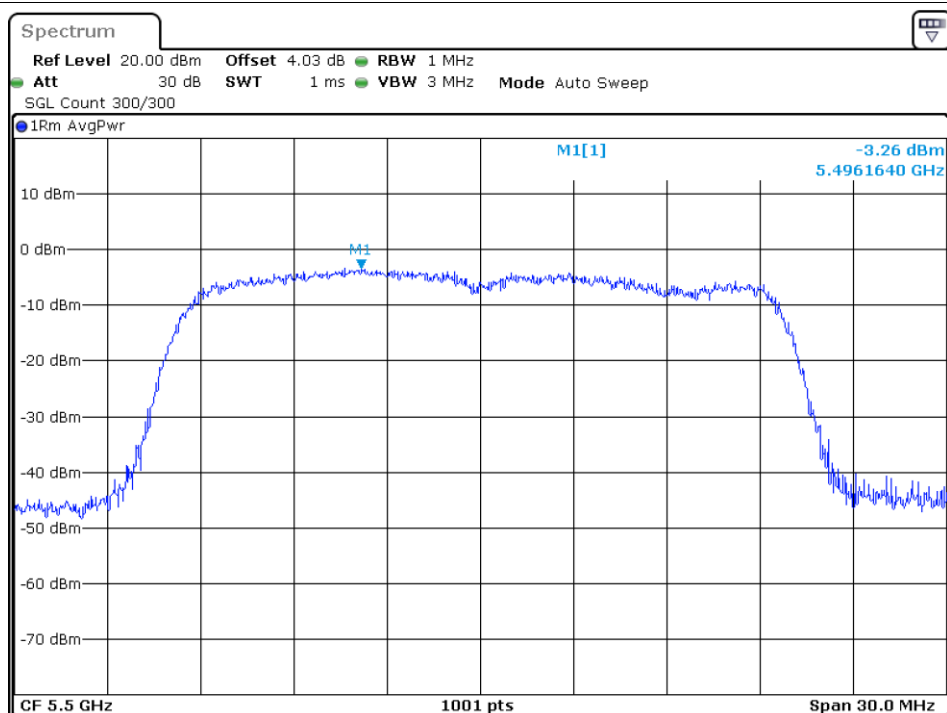


PSD NVNT ax20 5500MHz Ant1

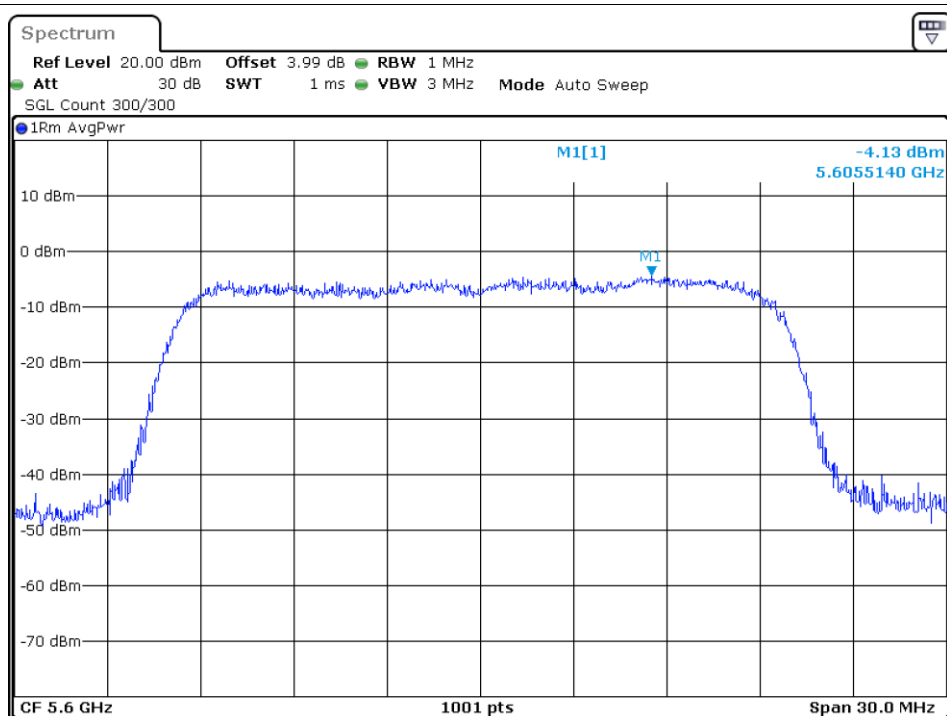


PSD NVNT ax20 5600MHz Ant1

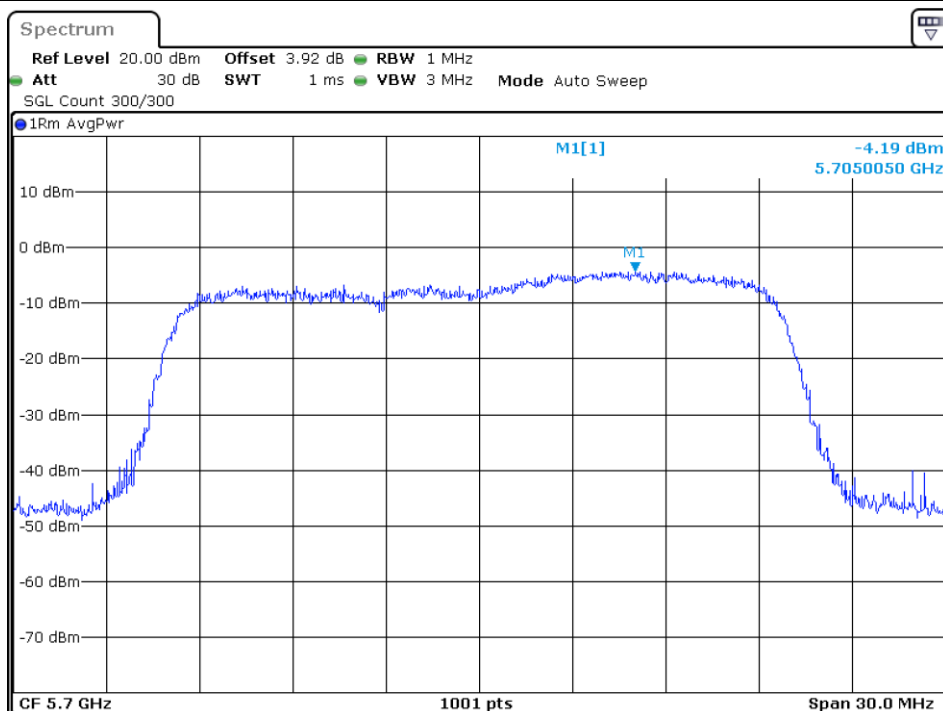

PSD NVNT ax20 5700MHz Ant1

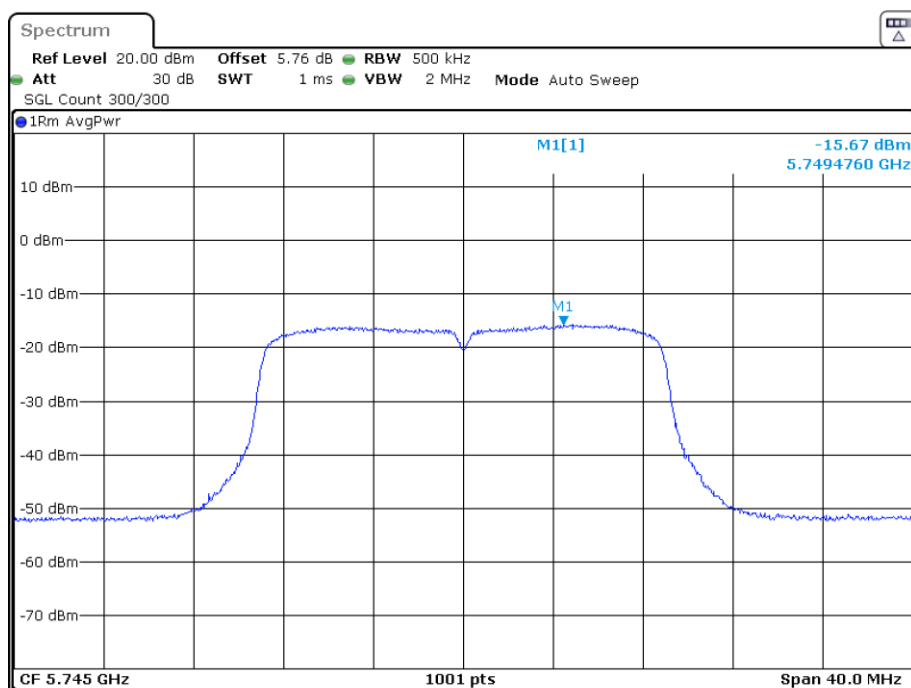


PSD NVNT ax20 5745MHz Ant1

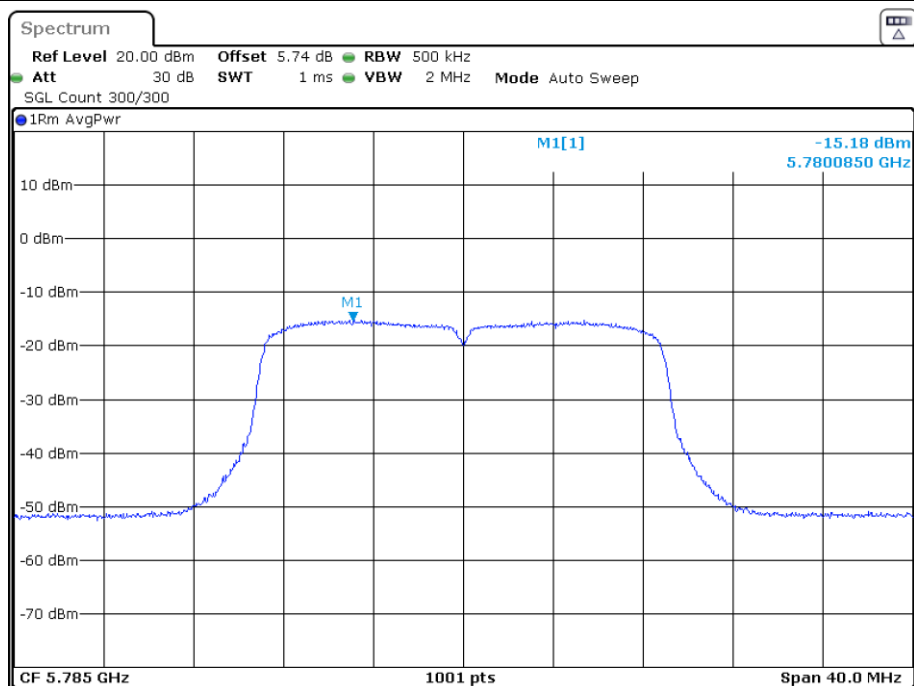

Date: 23.SEP.2026 17:55:25

PSD NVNT ax20 5785MHz Ant1

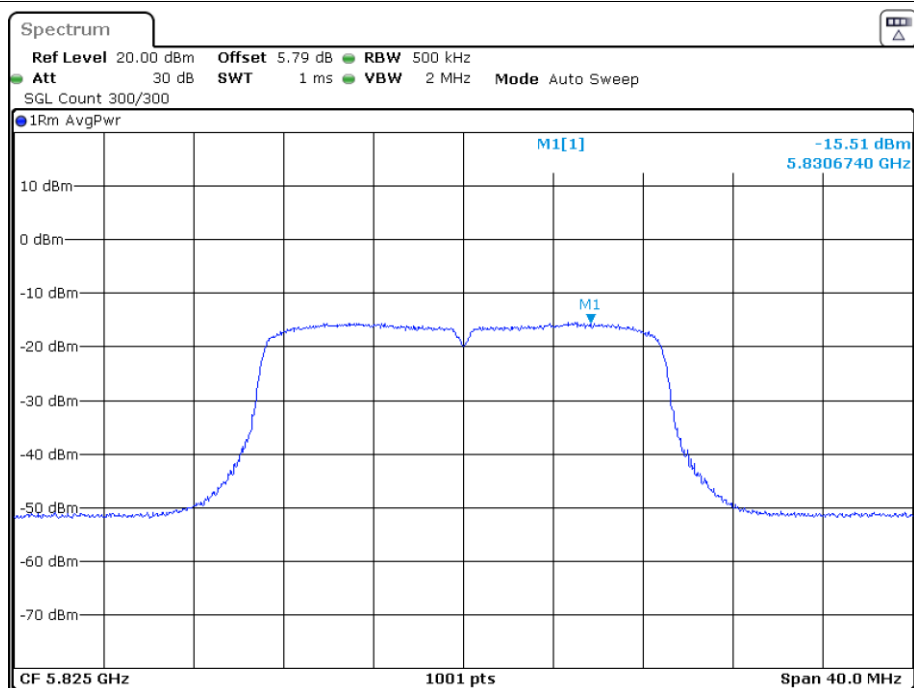

Date: 23.SEP.2026 17:56:17

PSD NVNT ax20 5825MHz Ant1

Appendix E Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
0C 120V	a	5180	Ant1	5179.986	-14000	-2.7	25	Pass
10C 120V	a	5180	Ant1	5179.986	-14000	-2.7	25	Pass
20C 120V	a	5180	Ant1	5179.986	-14000	-2.7	25	Pass
30C 120V	a	5180	Ant1	5179.985	-15000	-2.9	25	Pass
40C 120V	a	5180	Ant1	5179.985	-15000	-2.9	25	Pass
0C 120V	a	5200	Ant1	5199.987	-13000	-2.5	25	Pass
10C 120V	a	5200	Ant1	5199.986	-14000	-2.69	25	Pass
20C 120V	a	5200	Ant1	5199.986	-14000	-2.69	25	Pass
30C 120V	a	5200	Ant1	5199.986	-14000	-2.69	25	Pass
40C 120V	a	5200	Ant1	5199.985	-15000	-2.88	25	Pass
0C 120V	a	5240	Ant1	5239.986	-14000	-2.67	25	Pass
10C 120V	a	5240	Ant1	5239.986	-14000	-2.67	25	Pass
20C 120V	a	5240	Ant1	5239.986	-14000	-2.67	25	Pass
30C 120V	a	5240	Ant1	5239.985	-15000	-2.86	25	Pass
40C 120V	a	5240	Ant1	5239.985	-15000	-2.86	25	Pass
0C 120V	a	5260	Ant1	5259.981	-19000	-3.61	25	Pass
10C 120V	a	5260	Ant1	5259.981	-19000	-3.61	25	Pass
20C 120V	a	5260	Ant1	5259.981	-19000	-3.61	25	Pass
30C 120V	a	5260	Ant1	5259.981	-19000	-3.61	25	Pass
40C 120V	a	5260	Ant1	5259.981	-19000	-3.61	25	Pass
0C 120V	a	5280	Ant1	5279.982	-18000	-3.41	25	Pass
10C 120V	a	5280	Ant1	5279.982	-18000	-3.41	25	Pass
20C 120V	a	5280	Ant1	5279.981	-19000	-3.6	25	Pass
30C 120V	a	5280	Ant1	5279.981	-19000	-3.6	25	Pass
40C 120V	a	5280	Ant1	5279.981	-19000	-3.6	25	Pass
0C 120V	a	5320	Ant1	5319.982	-18000	-3.38	25	Pass
10C 120V	a	5320	Ant1	5319.981	-19000	-3.57	25	Pass
20C 120V	a	5320	Ant1	5319.981	-19000	-3.57	25	Pass
30C 120V	a	5320	Ant1	5319.981	-19000	-3.57	25	Pass
40C 120V	a	5320	Ant1	5319.981	-19000	-3.57	25	Pass
0C 120V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
10C 120V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
20C 120V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
30C 120V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
40C 120V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
0C 120V	a	5600	Ant1	5599.98	-20000	-3.57	25	Pass
10C 120V	a	5600	Ant1	5599.98	-20000	-3.57	25	Pass
20C 120V	a	5600	Ant1	5599.979	-21000	-3.75	25	Pass
30C 120V	a	5600	Ant1	5599.979	-21000	-3.75	25	Pass
40C 120V	a	5600	Ant1	5599.979	-21000	-3.75	25	Pass


0C 120V	a	5700	Ant1	5699.979	-21000	-3.68	25	Pass
10C 120V	a	5700	Ant1	5699.979	-21000	-3.68	25	Pass
20C 120V	a	5700	Ant1	5699.979	-21000	-3.68	25	Pass
30C 120V	a	5700	Ant1	5699.979	-21000	-3.68	25	Pass
40C 120V	a	5700	Ant1	5699.978	-22000	-3.86	25	Pass
0C 120V	a	5745	Ant1	5744.978	-22000	-3.83	25	Pass
10C 120V	a	5745	Ant1	5744.978	-22000	-3.83	25	Pass
20C 120V	a	5745	Ant1	5744.978	-22000	-3.83	25	Pass
30C 120V	a	5745	Ant1	5744.978	-22000	-3.83	25	Pass
40C 120V	a	5745	Ant1	5744.978	-22000	-3.83	25	Pass
0C 120V	a	5785	Ant1	5784.978	-22000	-3.8	25	Pass
10C 120V	a	5785	Ant1	5784.978	-22000	-3.8	25	Pass
20C 120V	a	5785	Ant1	5784.978	-22000	-3.8	25	Pass
30C 120V	a	5785	Ant1	5784.977	-23000	-3.98	25	Pass
40C 120V	a	5785	Ant1	5784.977	-23000	-3.98	25	Pass
0C 120V	a	5825	Ant1	5824.976	-24000	-4.12	25	Pass
10C 120V	a	5825	Ant1	5824.976	-24000	-4.12	25	Pass
20C 120V	a	5825	Ant1	5824.976	-24000	-4.12	25	Pass
30C 120V	a	5825	Ant1	5824.975	-25000	-4.29	25	Pass
40C 120V	a	5825	Ant1	5824.975	-25000	-4.29	25	Pass
0C 120V	n20	5180	Ant1	5179.982	-18000	-3.47	25	Pass
10C 120V	n20	5180	Ant1	5179.982	-18000	-3.47	25	Pass
20C 120V	n20	5180	Ant1	5179.982	-18000	-3.47	25	Pass
30C 120V	n20	5180	Ant1	5179.981	-19000	-3.67	25	Pass
40C 120V	n20	5180	Ant1	5179.981	-19000	-3.67	25	Pass
0C 120V	n20	5200	Ant1	5199.982	-18000	-3.46	25	Pass
10C 120V	n20	5200	Ant1	5199.982	-18000	-3.46	25	Pass
20C 120V	n20	5200	Ant1	5199.982	-18000	-3.46	25	Pass
30C 120V	n20	5200	Ant1	5199.981	-19000	-3.65	25	Pass
40C 120V	n20	5200	Ant1	5199.981	-19000	-3.65	25	Pass
0C 120V	n20	5240	Ant1	5239.984	-16000	-3.05	25	Pass
10C 120V	n20	5240	Ant1	5239.984	-16000	-3.05	25	Pass
20C 120V	n20	5240	Ant1	5239.984	-16000	-3.05	25	Pass
30C 120V	n20	5240	Ant1	5239.984	-16000	-3.05	25	Pass
40C 120V	n20	5240	Ant1	5239.983	-17000	-3.24	25	Pass
0C 120V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
10C 120V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 120V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
30C 120V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
40C 120V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
0C 120V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
10C 120V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 120V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
30C 120V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass

40C 120V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
0C 120V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
10C 120V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
20C 120V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
30C 120V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
40C 120V	n20	5320	Ant1	5319.979	-21000	-3.95	25	Pass
0C 120V	n20	5500	Ant1	5499.979	-21000	-3.82	25	Pass
10C 120V	n20	5500	Ant1	5499.979	-21000	-3.82	25	Pass
20C 120V	n20	5500	Ant1	5499.979	-21000	-3.82	25	Pass
30C 120V	n20	5500	Ant1	5499.979	-21000	-3.82	25	Pass
40C 120V	n20	5500	Ant1	5499.979	-21000	-3.82	25	Pass
0C 120V	n20	5600	Ant1	5599.978	-22000	-3.93	25	Pass
10C 120V	n20	5600	Ant1	5599.978	-22000	-3.93	25	Pass
20C 120V	n20	5600	Ant1	5599.978	-22000	-3.93	25	Pass
30C 120V	n20	5600	Ant1	5599.978	-22000	-3.93	25	Pass
40C 120V	n20	5600	Ant1	5599.978	-22000	-3.93	25	Pass
0C 120V	n20	5700	Ant1	5699.977	-23000	-4.04	25	Pass
10C 120V	n20	5700	Ant1	5699.977	-23000	-4.04	25	Pass
20C 120V	n20	5700	Ant1	5699.977	-23000	-4.04	25	Pass
30C 120V	n20	5700	Ant1	5699.977	-23000	-4.04	25	Pass
40C 120V	n20	5700	Ant1	5699.977	-23000	-4.04	25	Pass
0C 120V	n20	5745	Ant1	5744.977	-23000	-4	25	Pass
10C 120V	n20	5745	Ant1	5744.977	-23000	-4	25	Pass
20C 120V	n20	5745	Ant1	5744.977	-23000	-4	25	Pass
30C 120V	n20	5745	Ant1	5744.977	-23000	-4	25	Pass
40C 120V	n20	5745	Ant1	5744.977	-23000	-4	25	Pass
0C 120V	n20	5785	Ant1	5784.977	-23000	-3.98	25	Pass
10C 120V	n20	5785	Ant1	5784.976	-24000	-4.15	25	Pass
20C 120V	n20	5785	Ant1	5784.976	-24000	-4.15	25	Pass
30C 120V	n20	5785	Ant1	5784.976	-24000	-4.15	25	Pass
40C 120V	n20	5785	Ant1	5784.976	-24000	-4.15	25	Pass
0C 120V	n20	5825	Ant1	5824.976	-24000	-4.12	25	Pass
10C 120V	n20	5825	Ant1	5824.976	-24000	-4.12	25	Pass
20C 120V	n20	5825	Ant1	5824.976	-24000	-4.12	25	Pass
30C 120V	n20	5825	Ant1	5824.976	-24000	-4.12	25	Pass
40C 120V	n20	5825	Ant1	5824.976	-24000	-4.12	25	Pass
0C 120V	ac20	5180	Ant1	5179.981	-19000	-3.67	25	Pass
10C 120V	ac20	5180	Ant1	5179.981	-19000	-3.67	25	Pass
20C 120V	ac20	5180	Ant1	5179.981	-19000	-3.67	25	Pass
30C 120V	ac20	5180	Ant1	5179.981	-19000	-3.67	25	Pass
40C 120V	ac20	5180	Ant1	5179.981	-19000	-3.67	25	Pass
0C 120V	ac20	5200	Ant1	5199.981	-19000	-3.65	25	Pass
10C 120V	ac20	5200	Ant1	5199.981	-19000	-3.65	25	Pass
20C 120V	ac20	5200	Ant1	5199.981	-19000	-3.65	25	Pass


30C 120V	ac20	5200	Ant1	5199.981	-19000	-3.65	25	Pass
40C 120V	ac20	5200	Ant1	5199.981	-19000	-3.65	25	Pass
0C 120V	ac20	5240	Ant1	5239.983	-17000	-3.24	25	Pass
10C 120V	ac20	5240	Ant1	5239.983	-17000	-3.24	25	Pass
20C 120V	ac20	5240	Ant1	5239.983	-17000	-3.24	25	Pass
30C 120V	ac20	5240	Ant1	5239.983	-17000	-3.24	25	Pass
40C 120V	ac20	5240	Ant1	5239.983	-17000	-3.24	25	Pass
0C 120V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
10C 120V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 120V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
30C 120V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
40C 120V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
0C 120V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
10C 120V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 120V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
30C 120V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
40C 120V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
0C 120V	ac20	5320	Ant1	5319.979	-21000	-3.95	25	Pass
10C 120V	ac20	5320	Ant1	5319.979	-21000	-3.95	25	Pass
20C 120V	ac20	5320	Ant1	5319.979	-21000	-3.95	25	Pass
30C 120V	ac20	5320	Ant1	5319.979	-21000	-3.95	25	Pass
40C 120V	ac20	5320	Ant1	5319.979	-21000	-3.95	25	Pass
0C 120V	ac20	5500	Ant1	5499.978	-22000	-4	25	Pass
10C 120V	ac20	5500	Ant1	5499.979	-21000	-3.82	25	Pass
20C 120V	ac20	5500	Ant1	5499.978	-22000	-4	25	Pass
30C 120V	ac20	5500	Ant1	5499.978	-22000	-4	25	Pass
40C 120V	ac20	5500	Ant1	5499.978	-22000	-4	25	Pass
0C 120V	ac20	5600	Ant1	5599.978	-22000	-3.93	25	Pass
10C 120V	ac20	5600	Ant1	5599.978	-22000	-3.93	25	Pass
20C 120V	ac20	5600	Ant1	5599.978	-22000	-3.93	25	Pass
30C 120V	ac20	5600	Ant1	5599.978	-22000	-3.93	25	Pass
40C 120V	ac20	5600	Ant1	5599.978	-22000	-3.93	25	Pass
0C 120V	ac20	5700	Ant1	5699.976	-24000	-4.21	25	Pass
10C 120V	ac20	5700	Ant1	5699.976	-24000	-4.21	25	Pass
20C 120V	ac20	5700	Ant1	5699.976	-24000	-4.21	25	Pass
30C 120V	ac20	5700	Ant1	5699.976	-24000	-4.21	25	Pass
40C 120V	ac20	5700	Ant1	5699.976	-24000	-4.21	25	Pass
0C 120V	ac20	5745	Ant1	5744.976	-24000	-4.18	25	Pass
10C 120V	ac20	5745	Ant1	5744.976	-24000	-4.18	25	Pass
20C 120V	ac20	5745	Ant1	5744.976	-24000	-4.18	25	Pass
30C 120V	ac20	5745	Ant1	5744.976	-24000	-4.18	25	Pass
40C 120V	ac20	5745	Ant1	5744.976	-24000	-4.18	25	Pass
0C 120V	ac20	5785	Ant1	5784.976	-24000	-4.15	25	Pass
10C 120V	ac20	5785	Ant1	5784.976	-24000	-4.15	25	Pass

20C 120V	ac20	5785	Ant1	5784.976	-24000	-4.15	25	Pass
30C 120V	ac20	5785	Ant1	5784.976	-24000	-4.15	25	Pass
40C 120V	ac20	5785	Ant1	5784.976	-24000	-4.15	25	Pass
0C 120V	ac20	5825	Ant1	5824.977	-23000	-3.95	25	Pass
10C 120V	ac20	5825	Ant1	5824.977	-23000	-3.95	25	Pass
20C 120V	ac20	5825	Ant1	5824.976	-24000	-4.12	25	Pass
30C 120V	ac20	5825	Ant1	5824.976	-24000	-4.12	25	Pass
40C 120V	ac20	5825	Ant1	5824.976	-24000	-4.12	25	Pass
0C 120V	ax20	5180	Ant1	5179.981	-19000	-3.67	25	Pass
10C 120V	ax20	5180	Ant1	5179.981	-19000	-3.67	25	Pass
20C 120V	ax20	5180	Ant1	5179.981	-19000	-3.67	25	Pass
30C 120V	ax20	5180	Ant1	5179.981	-19000	-3.67	25	Pass
40C 120V	ax20	5180	Ant1	5179.981	-19000	-3.67	25	Pass
0C 120V	ax20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
10C 120V	ax20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
20C 120V	ax20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
30C 120V	ax20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
40C 120V	ax20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
0C 120V	ax20	5240	Ant1	5239.982	-18000	-3.44	25	Pass
10C 120V	ax20	5240	Ant1	5239.982	-18000	-3.44	25	Pass
20C 120V	ax20	5240	Ant1	5239.982	-18000	-3.44	25	Pass
30C 120V	ax20	5240	Ant1	5239.982	-18000	-3.44	25	Pass
40C 120V	ax20	5240	Ant1	5239.982	-18000	-3.44	25	Pass
0C 120V	ax20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
10C 120V	ax20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 120V	ax20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
30C 120V	ax20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
40C 120V	ax20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
0C 120V	ax20	5280	Ant1	5279.979	-21000	-3.98	25	Pass
10C 120V	ax20	5280	Ant1	5279.979	-21000	-3.98	25	Pass
20C 120V	ax20	5280	Ant1	5279.979	-21000	-3.98	25	Pass
30C 120V	ax20	5280	Ant1	5279.979	-21000	-3.98	25	Pass
40C 120V	ax20	5280	Ant1	5279.979	-21000	-3.98	25	Pass
0C 120V	ax20	5320	Ant1	5319.979	-21000	-3.95	25	Pass
10C 120V	ax20	5320	Ant1	5319.979	-21000	-3.95	25	Pass
20C 120V	ax20	5320	Ant1	5319.979	-21000	-3.95	25	Pass
30C 120V	ax20	5320	Ant1	5319.979	-21000	-3.95	25	Pass
40C 120V	ax20	5320	Ant1	5319.979	-21000	-3.95	25	Pass
0C 120V	ax20	5500	Ant1	5499.978	-22000	-4	25	Pass
10C 120V	ax20	5500	Ant1	5499.978	-22000	-4	25	Pass
20C 120V	ax20	5500	Ant1	5499.978	-22000	-4	25	Pass
30C 120V	ax20	5500	Ant1	5499.978	-22000	-4	25	Pass
40C 120V	ax20	5500	Ant1	5499.978	-22000	-4	25	Pass
0C 120V	ax20	5600	Ant1	5599.978	-22000	-3.93	25	Pass


10C 120V	ax20	5600	Ant1	5599.978	-22000	-3.93	25	Pass
20C 120V	ax20	5600	Ant1	5599.977	-23000	-4.11	25	Pass
30C 120V	ax20	5600	Ant1	5599.977	-23000	-4.11	25	Pass
40C 120V	ax20	5600	Ant1	5599.977	-23000	-4.11	25	Pass
0C 120V	ax20	5700	Ant1	5699.976	-24000	-4.21	25	Pass
10C 120V	ax20	5700	Ant1	5699.976	-24000	-4.21	25	Pass
20C 120V	ax20	5700	Ant1	5699.976	-24000	-4.21	25	Pass
30C 120V	ax20	5700	Ant1	5699.976	-24000	-4.21	25	Pass
40C 120V	ax20	5700	Ant1	5699.976	-24000	-4.21	25	Pass
0C 120V	ax20	5745	Ant1	5744.975	-25000	-4.35	25	Pass
10C 120V	ax20	5745	Ant1	5744.975	-25000	-4.35	25	Pass
20C 120V	ax20	5745	Ant1	5744.975	-25000	-4.35	25	Pass
30C 120V	ax20	5745	Ant1	5744.975	-25000	-4.35	25	Pass
40C 120V	ax20	5745	Ant1	5744.975	-25000	-4.35	25	Pass
0C 120V	ax20	5785	Ant1	5784.976	-24000	-4.15	25	Pass
10C 120V	ax20	5785	Ant1	5784.976	-24000	-4.15	25	Pass
20C 120V	ax20	5785	Ant1	5784.976	-24000	-4.15	25	Pass
30C 120V	ax20	5785	Ant1	5784.976	-24000	-4.15	25	Pass
40C 120V	ax20	5785	Ant1	5784.976	-24000	-4.15	25	Pass
0C 120V	ax20	5825	Ant1	5824.978	-22000	-3.78	25	Pass
10C 120V	ax20	5825	Ant1	5824.978	-22000	-3.78	25	Pass
20C 120V	ax20	5825	Ant1	5824.978	-22000	-3.78	25	Pass
30C 120V	ax20	5825	Ant1	5824.977	-23000	-3.95	25	Pass
40C 120V	ax20	5825	Ant1	5824.977	-23000	-3.95	25	Pass

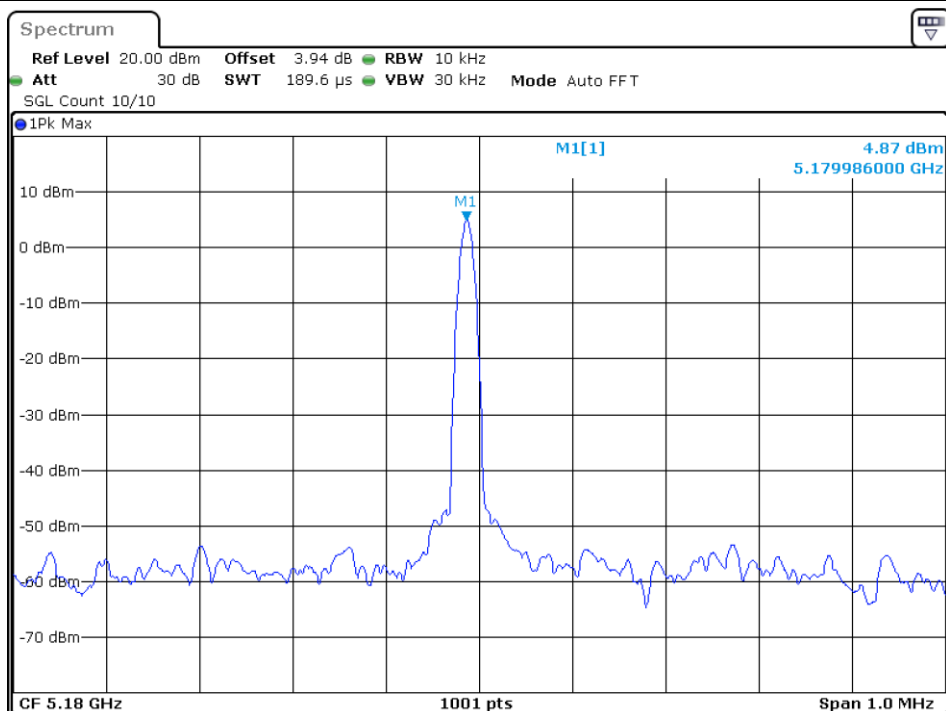


Freq. Stability 0C 120V a 5180MHz Ant1

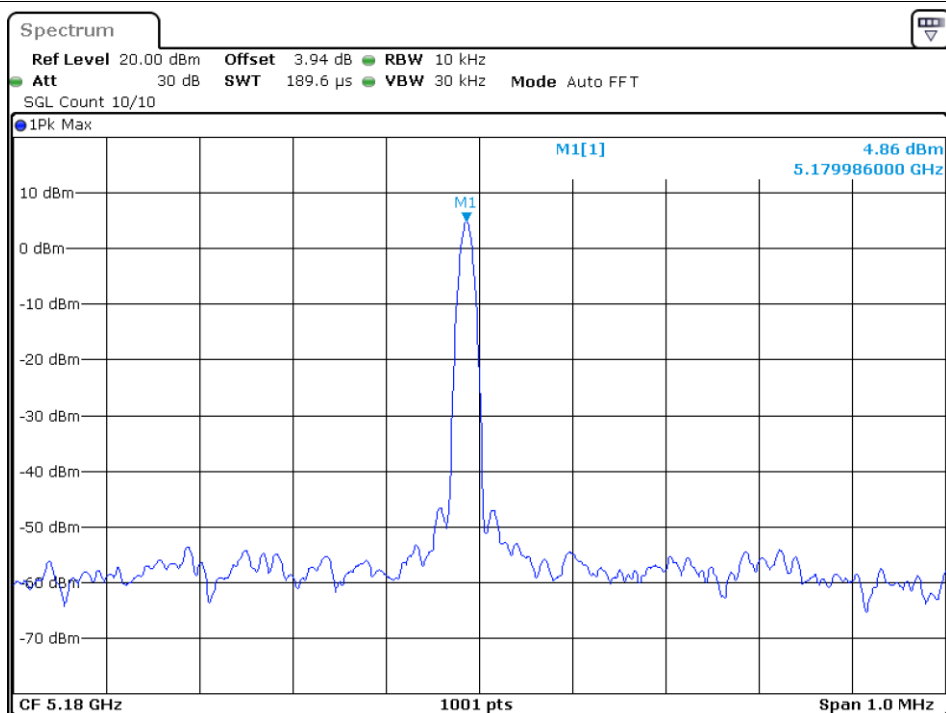


Freq. Stability 10C 120V a 5180MHz Ant1

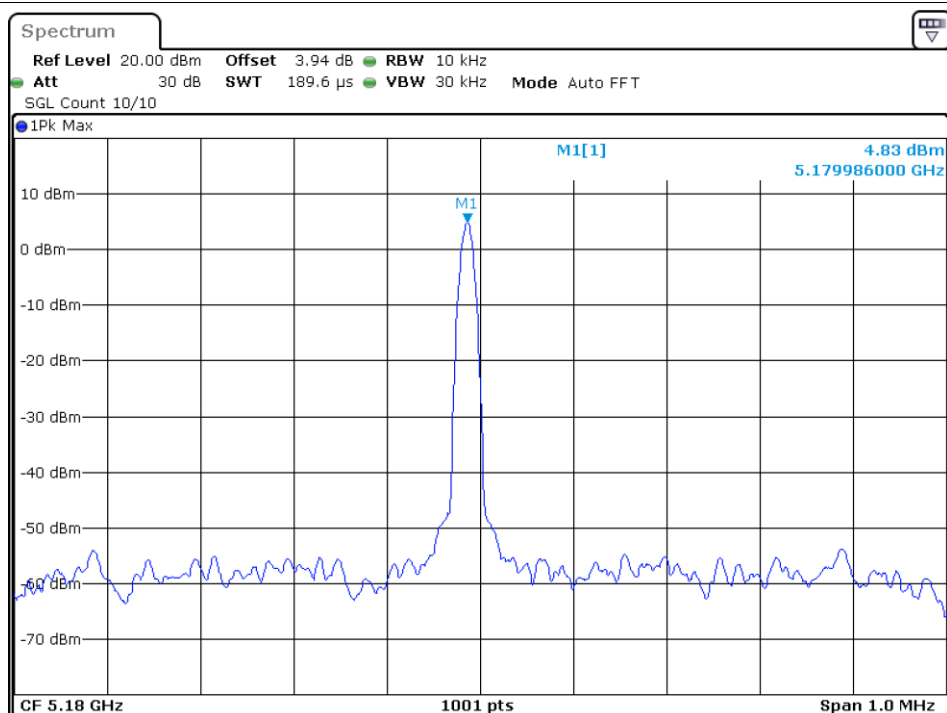


Freq. Stability 20C 120V a 5180MHz Ant1

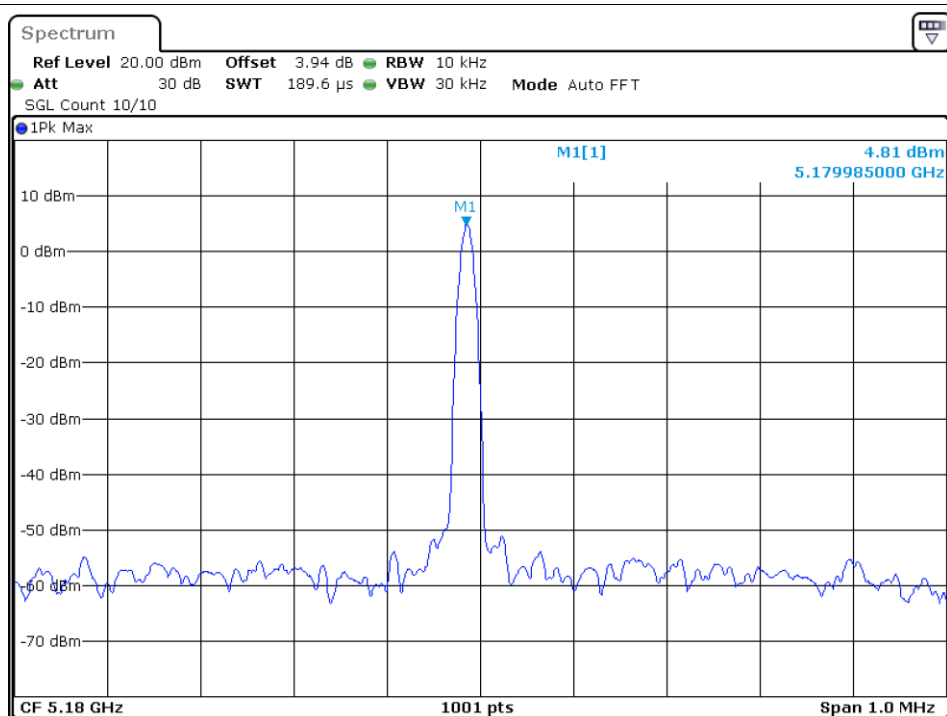


Freq. Stability 30C 120V a 5180MHz Ant1

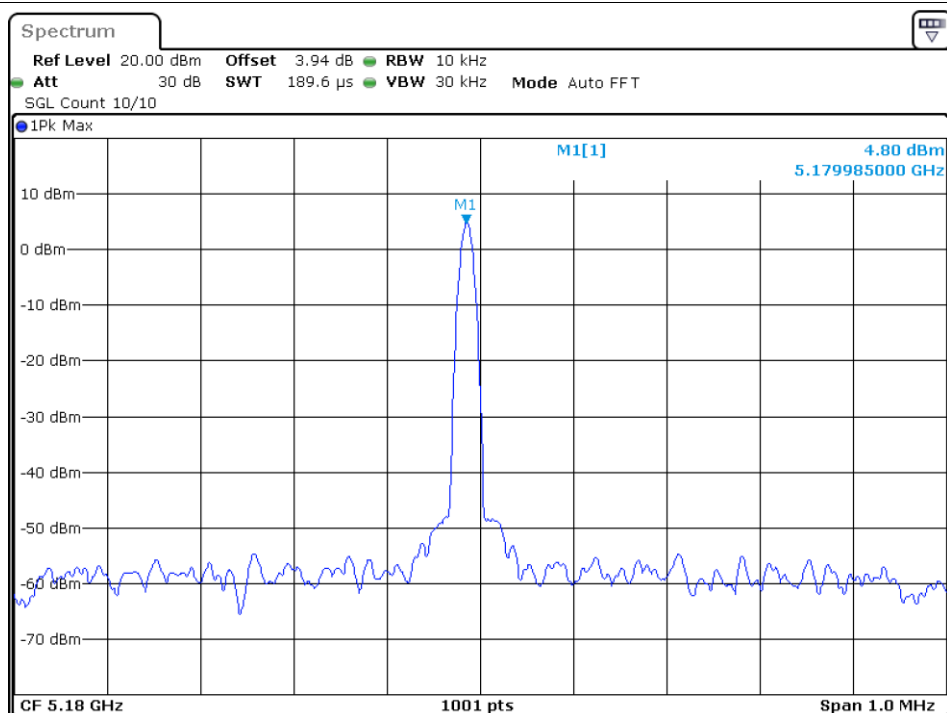


Freq. Stability 40C 120V a 5180MHz Ant1

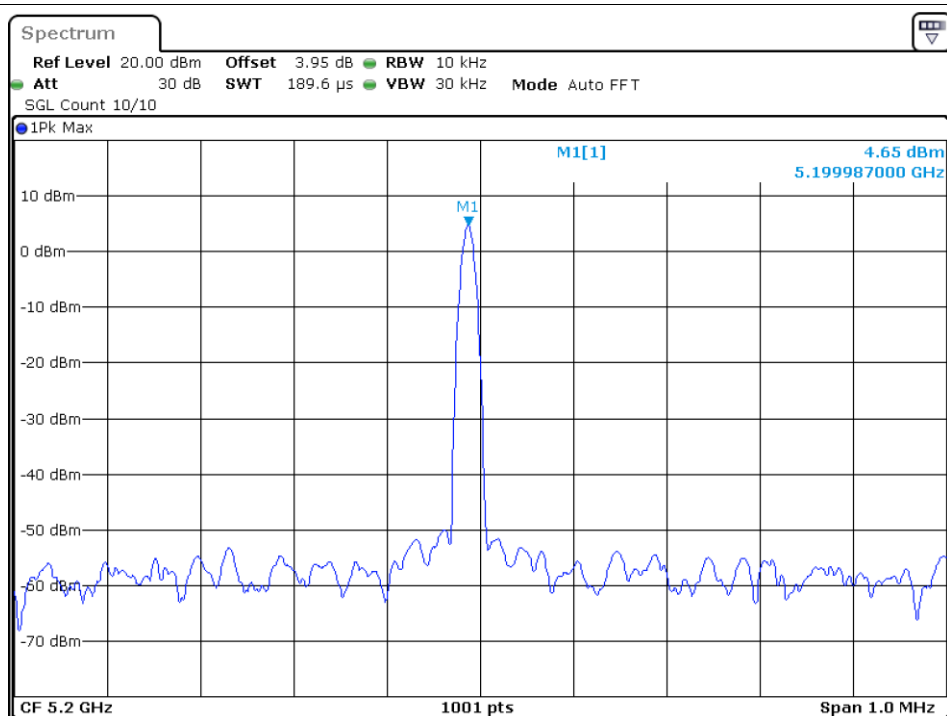


Freq. Stability 0C 120V a 5200MHz Ant1

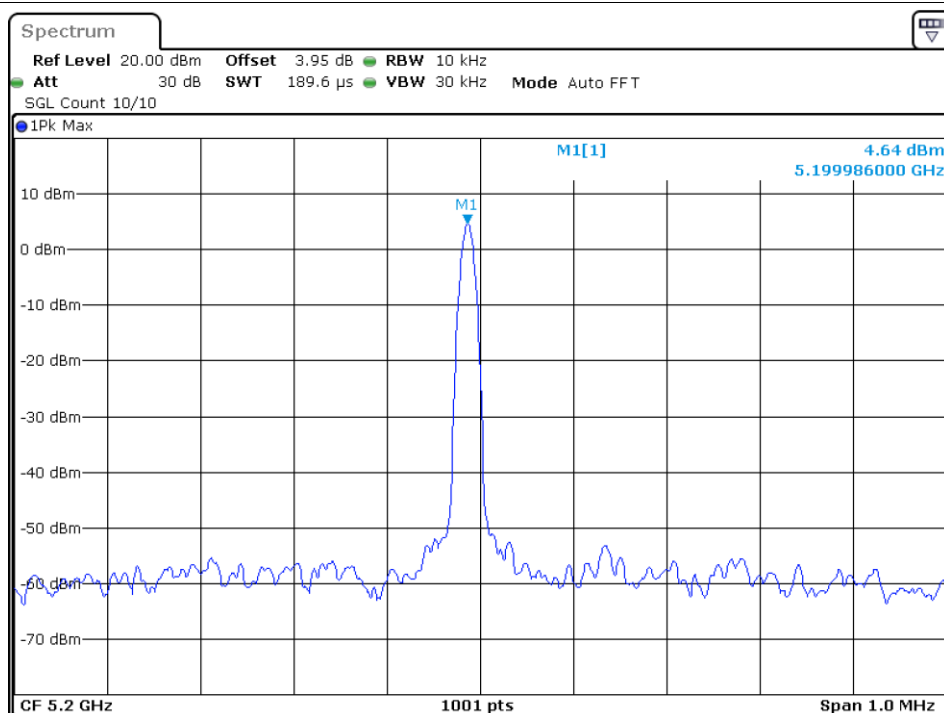


Freq. Stability 10C 120V a 5200MHz Ant1

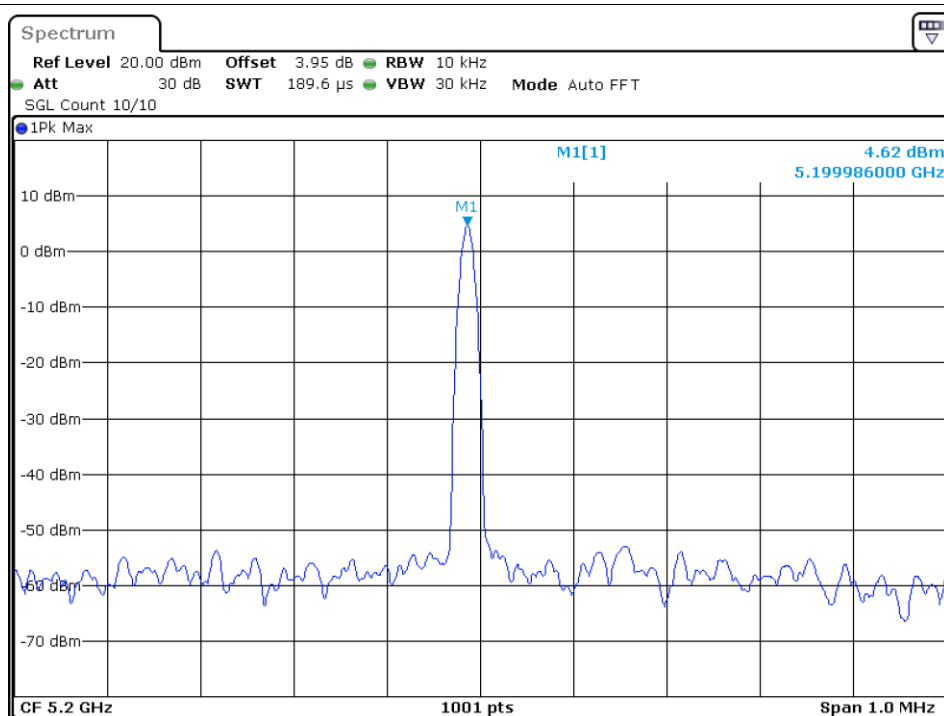

Freq. Stability 20C 120V a 5200MHz Ant1

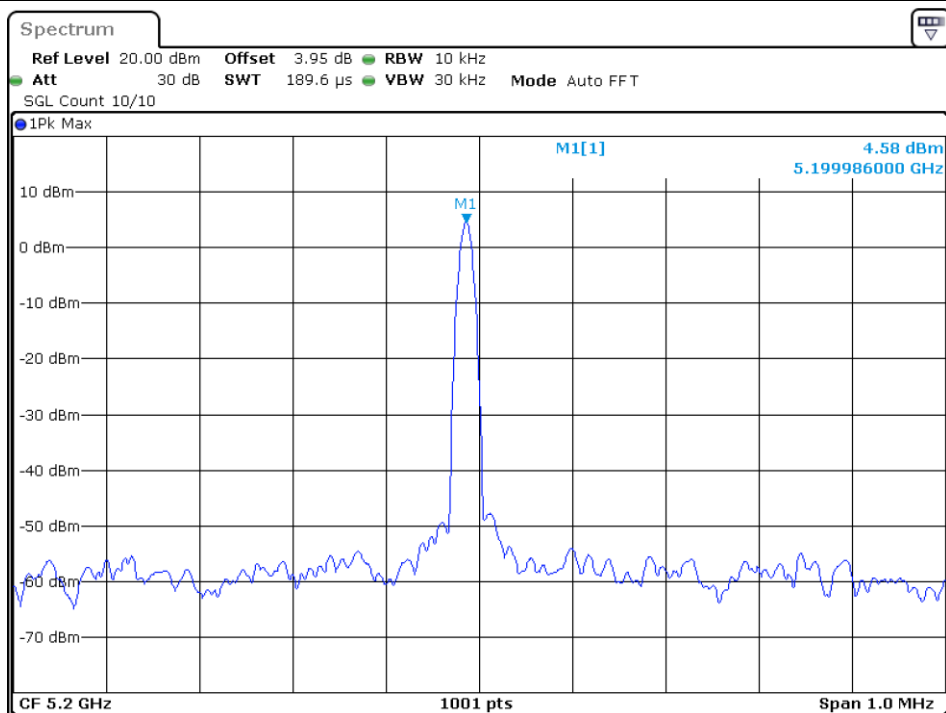

Freq. Stability 30C 120V a 5200MHz Ant1

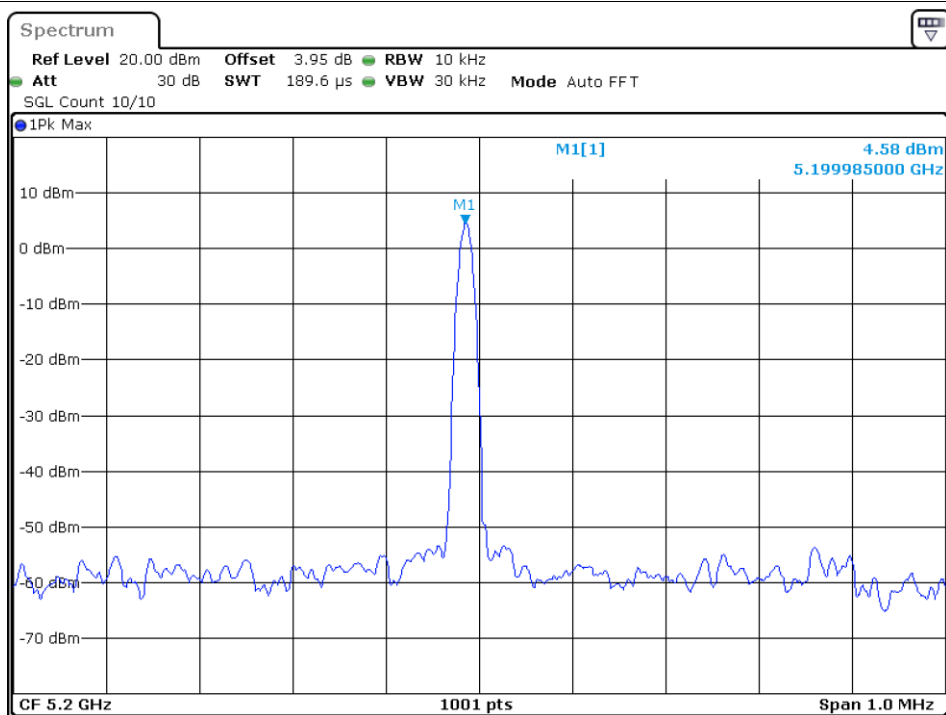

Freq. Stability 40C 120V a 5200MHz Ant1