

Appendix Test Data

Report No.:	1812C60351212503-01	Test Sample No.:	1-2-2
Start Test Date:	2026-6-25	Finish Test Date:	2026-7-8
Test Engineer:	Huisen Guan	Auditor:	Justin Feng
Temperature:	26.9℃	Relative Humidity:	55%
Pressure:	101kPa		



Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	26.000	5166.720	5192.720	---	---
11A	Ant1	5220	26.120	5206.880	5233.000	---	---
11A	Ant1	5240	26.800	5226.880	5253.680	---	---
11A	Ant1	5260	27.040	5246.440	5273.480	---	---
11A	Ant1	5300	25.800	5287.520	5313.320	---	---
11A	Ant1	5320	26.080	5306.880	5332.960	---	---
11A	Ant1	5500	27.120	5486.680	5513.800	---	---
11A	Ant1	5580	27.920	5566.080	5594.000	---	---
11A	Ant1	5700	27.080	5686.480	5713.560	---	---
11A	Ant1	5745	26.440	5731.400	5757.840	---	---
11A	Ant1	5785	26.760	5771.560	5798.320	---	---
11A	Ant1	5825	27.200	5810.720	5837.920	---	---
11N20SISO	Ant1	5180	27.760	5166.080	5193.840	---	---
11N20SISO	Ant1	5220	28.000	5205.600	5233.600	---	---
11N20SISO	Ant1	5240	27.400	5226.280	5253.680	---	---
11N20SISO	Ant1	5260	27.440	5246.120	5273.560	---	---
11N20SISO	Ant1	5300	26.880	5286.240	5313.120	---	---
11N20SISO	Ant1	5320	26.680	5306.800	5333.480	---	---
11N20SISO	Ant1	5500	28.000	5485.840	5513.840	---	---
11N20SISO	Ant1	5580	28.320	5566.160	5594.480	---	---
11N20SISO	Ant1	5700	27.920	5686.160	5714.080	---	---
11N20SISO	Ant1	5745	27.200	5731.080	5758.280	---	---
11N20SISO	Ant1	5785	28.360	5770.600	5798.960	---	---
11N20SISO	Ant1	5825	27.800	5811.200	5839.000	---	---
11N40SISO	Ant1	5190	45.840	5166.720	5212.560	---	---

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

11N40SISO	Ant1	5230	46.560	5206.800	5253.360	---	---
11N40SISO	Ant1	5270	47.440	5246.720	5294.160	---	---
11N40SISO	Ant1	5310	47.680	5286.320	5334.000	---	---
11N40SISO	Ant1	5510	48.880	5485.520	5534.400	---	---
11N40SISO	Ant1	5550	47.440	5526.480	5573.920	---	---
11N40SISO	Ant1	5670	48.880	5645.360	5694.240	---	---
11N40SISO	Ant1	5755	48.640	5730.120	5778.760	---	---
11N40SISO	Ant1	5795	48.800	5770.280	5819.080	---	---
11AC20SISO	Ant1	5180	27.320	5166.640	5193.960	---	---
11AC20SISO	Ant1	5220	26.960	5206.800	5233.760	---	---
11AC20SISO	Ant1	5240	27.600	5226.280	5253.880	---	---
11AC20SISO	Ant1	5260	27.480	5246.200	5273.680	---	---
11AC20SISO	Ant1	5300	27.360	5286.160	5313.520	---	---
11AC20SISO	Ant1	5320	27.120	5306.440	5333.560	---	---
11AC20SISO	Ant1	5500	27.760	5486.680	5514.440	---	---
11AC20SISO	Ant1	5580	27.200	5566.560	5593.760	---	---
11AC20SISO	Ant1	5700	29.440	5685.080	5714.520	---	---
11AC20SISO	Ant1	5745	27.840	5730.840	5758.680	---	---
11AC20SISO	Ant1	5785	28.400	5770.320	5798.720	---	---
11AC20SISO	Ant1	5825	27.640	5810.600	5838.240	---	---
11AC40SISO	Ant1	5190	47.440	5166.560	5214.000	---	---
11AC40SISO	Ant1	5230	47.520	5206.480	5254.000	---	---
11AC40SISO	Ant1	5270	47.600	5246.560	5294.160	---	---
11AC40SISO	Ant1	5310	46.400	5286.880	5333.280	---	---
11AC40SISO	Ant1	5510	48.720	5485.920	5534.640	---	---
11AC40SISO	Ant1	5550	48.160	5526.480	5574.640	---	---
11AC40SISO	Ant1	5670	50.080	5645.280	5695.360	---	---
11AC40SISO	Ant1	5755	48.400	5731.080	5779.480	---	---
11AC40SISO	Ant1	5795	48.960	5769.720	5818.680	---	---
11AC80SISO	Ant1	5210	86.720	5166.960	5253.680	---	---
11AC80SISO	Ant1	5290	88.000	5246.000	5334.000	---	---
11AC80SISO	Ant1	5530	89.280	5485.680	5574.960	---	---
11AC80SISO	Ant1	5775	88.000	5731.000	5819.000	---	---
11AX20SISO	Ant1	5180	29.000	5166.360	5195.360	---	---
11AX20SISO	Ant1	5220	26.840	5207.320	5234.160	---	---
11AX20SISO	Ant1	5240	28.480	5226.680	5255.160	---	---
11AX20SISO	Ant1	5260	27.640	5247.800	5275.440	---	---
11AX20SISO	Ant1	5300	29.600	5286.600	5316.200	---	---
11AX20SISO	Ant1	5320	28.160	5307.320	5335.480	---	---
11AX20SISO	Ant1	5500	26.600	5487.400	5514.000	---	---
11AX20SISO	Ant1	5580	28.800	5566.520	5595.320	---	---
11AX20SISO	Ant1	5700	29.440	5686.520	5715.960	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


11AX20SISO	Ant1	5745	29.760	5731.200	5760.960	---	---
11AX20SISO	Ant1	5785	28.600	5771.760	5800.360	---	---
11AX20SISO	Ant1	5825	29.520	5810.960	5840.480	---	---
11AX40SISO	Ant1	5190	44.800	5167.600	5212.400	---	---
11AX40SISO	Ant1	5230	45.680	5207.920	5253.600	---	---
11AX40SISO	Ant1	5270	46.400	5246.800	5293.200	---	---
11AX40SISO	Ant1	5310	46.480	5286.880	5333.360	---	---
11AX40SISO	Ant1	5510	45.600	5487.440	5533.040	---	---
11AX40SISO	Ant1	5550	46.720	5526.080	5572.800	---	---
11AX40SISO	Ant1	5670	47.360	5646.320	5693.680	---	---
11AX40SISO	Ant1	5755	47.680	5731.480	5779.160	---	---
11AX40SISO	Ant1	5795	45.840	5771.480	5817.320	---	---
11AX80SISO	Ant1	5210	91.040	5164.560	5255.600	---	---
11AX80SISO	Ant1	5290	88.320	5246.480	5334.800	---	---
11AX80SISO	Ant1	5530	89.280	5486.320	5575.600	---	---
11AX80SISO	Ant1	5775	89.120	5729.080	5818.200	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

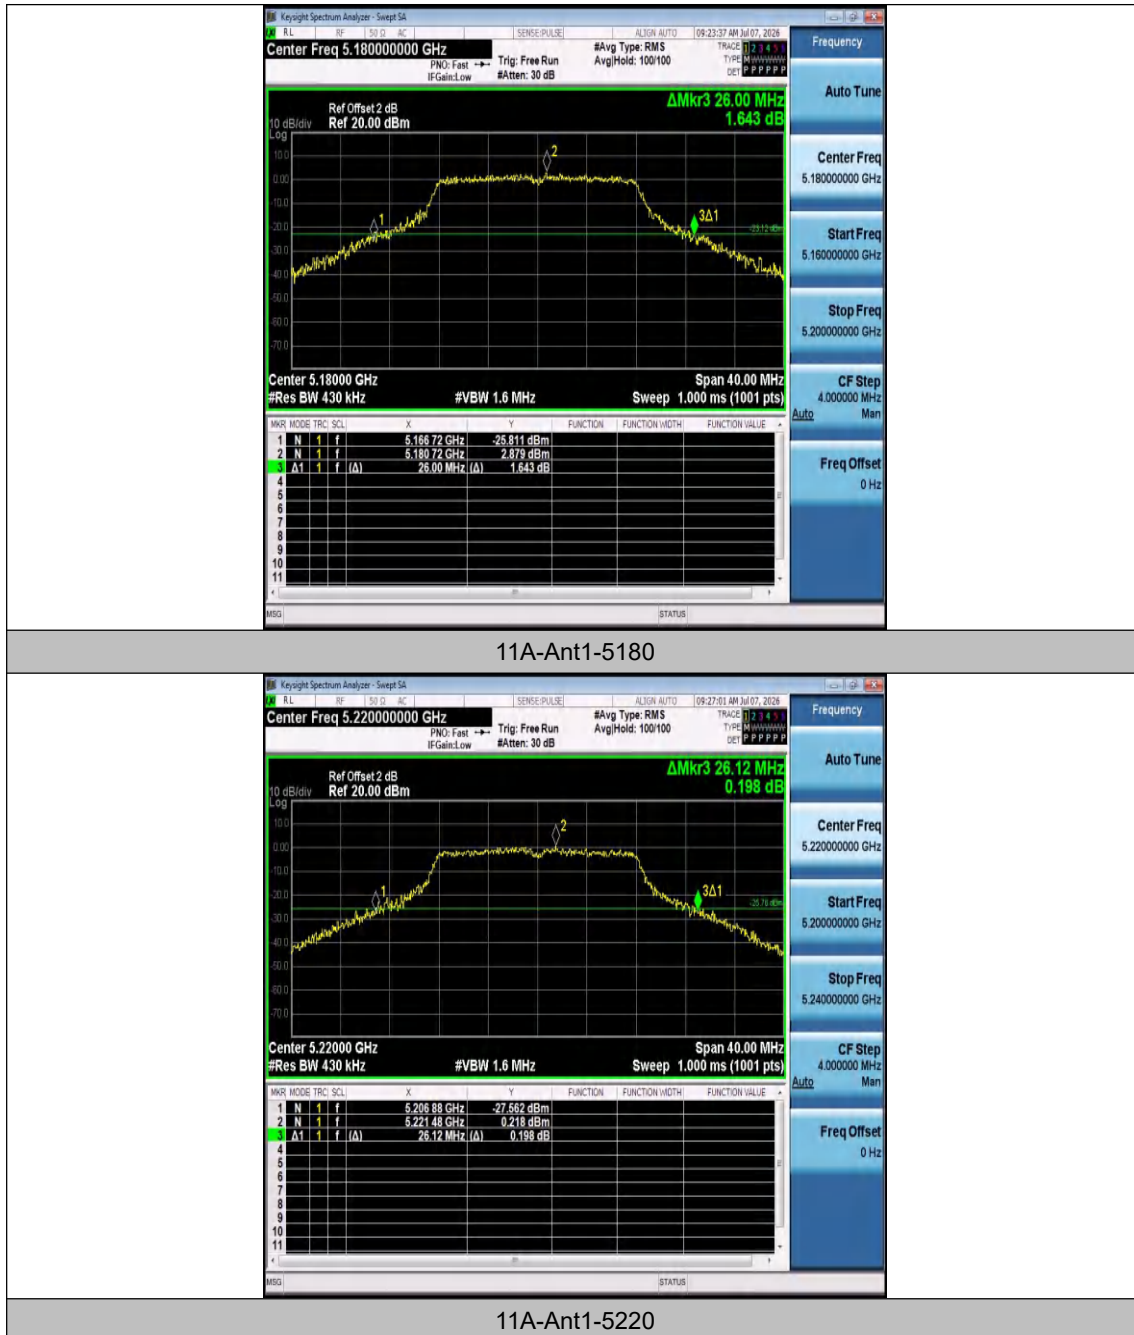

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

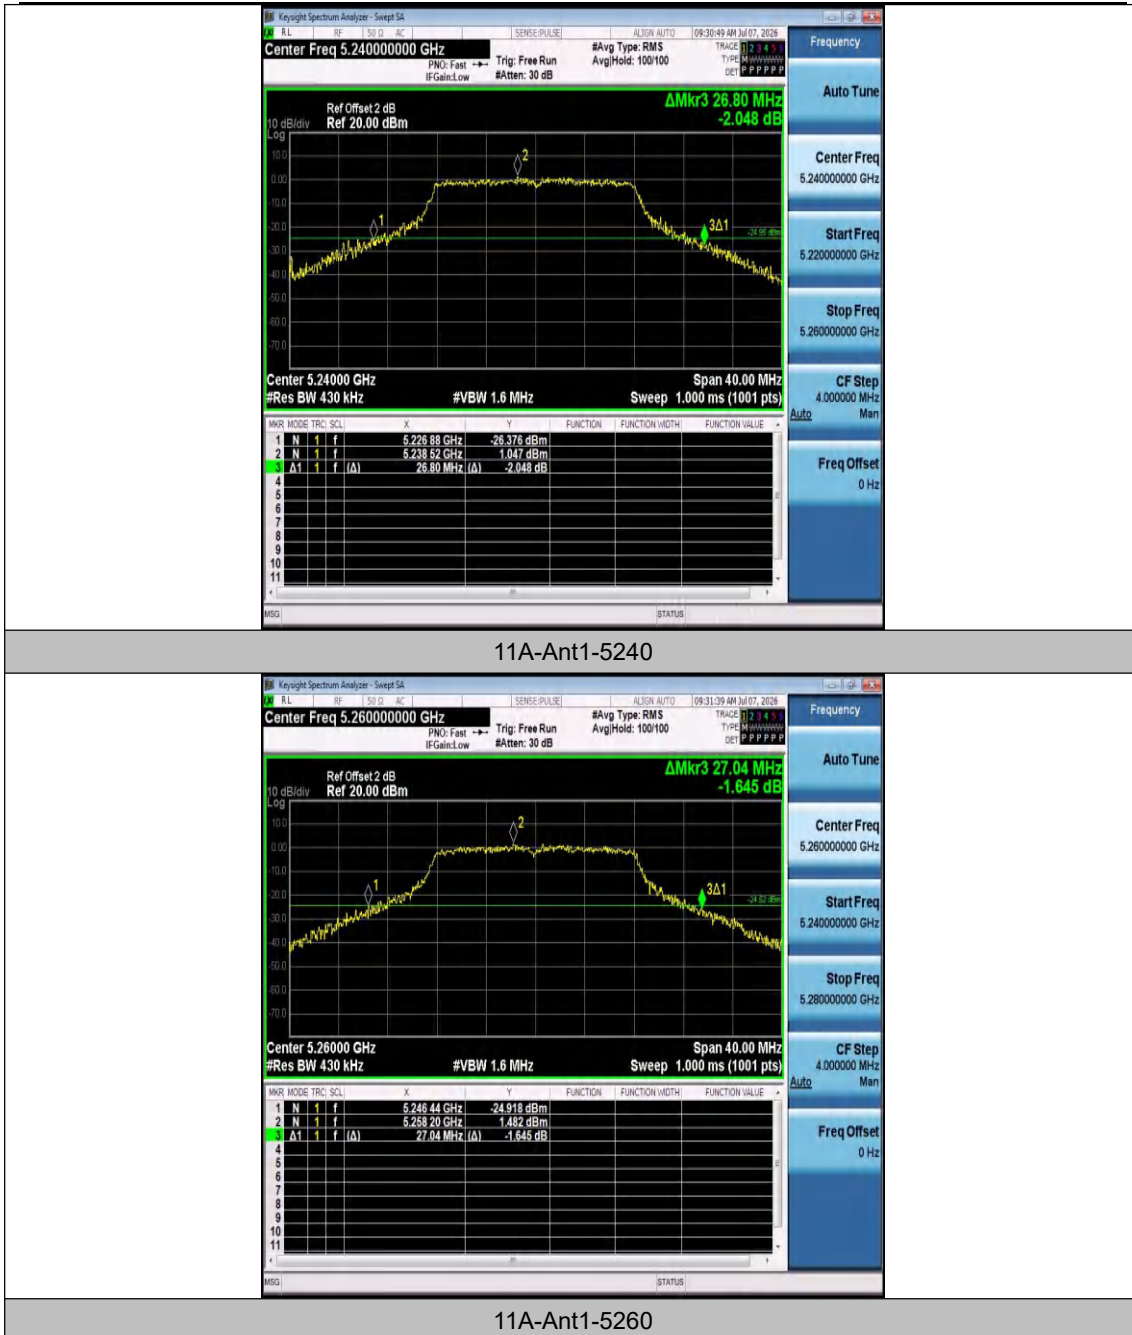

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

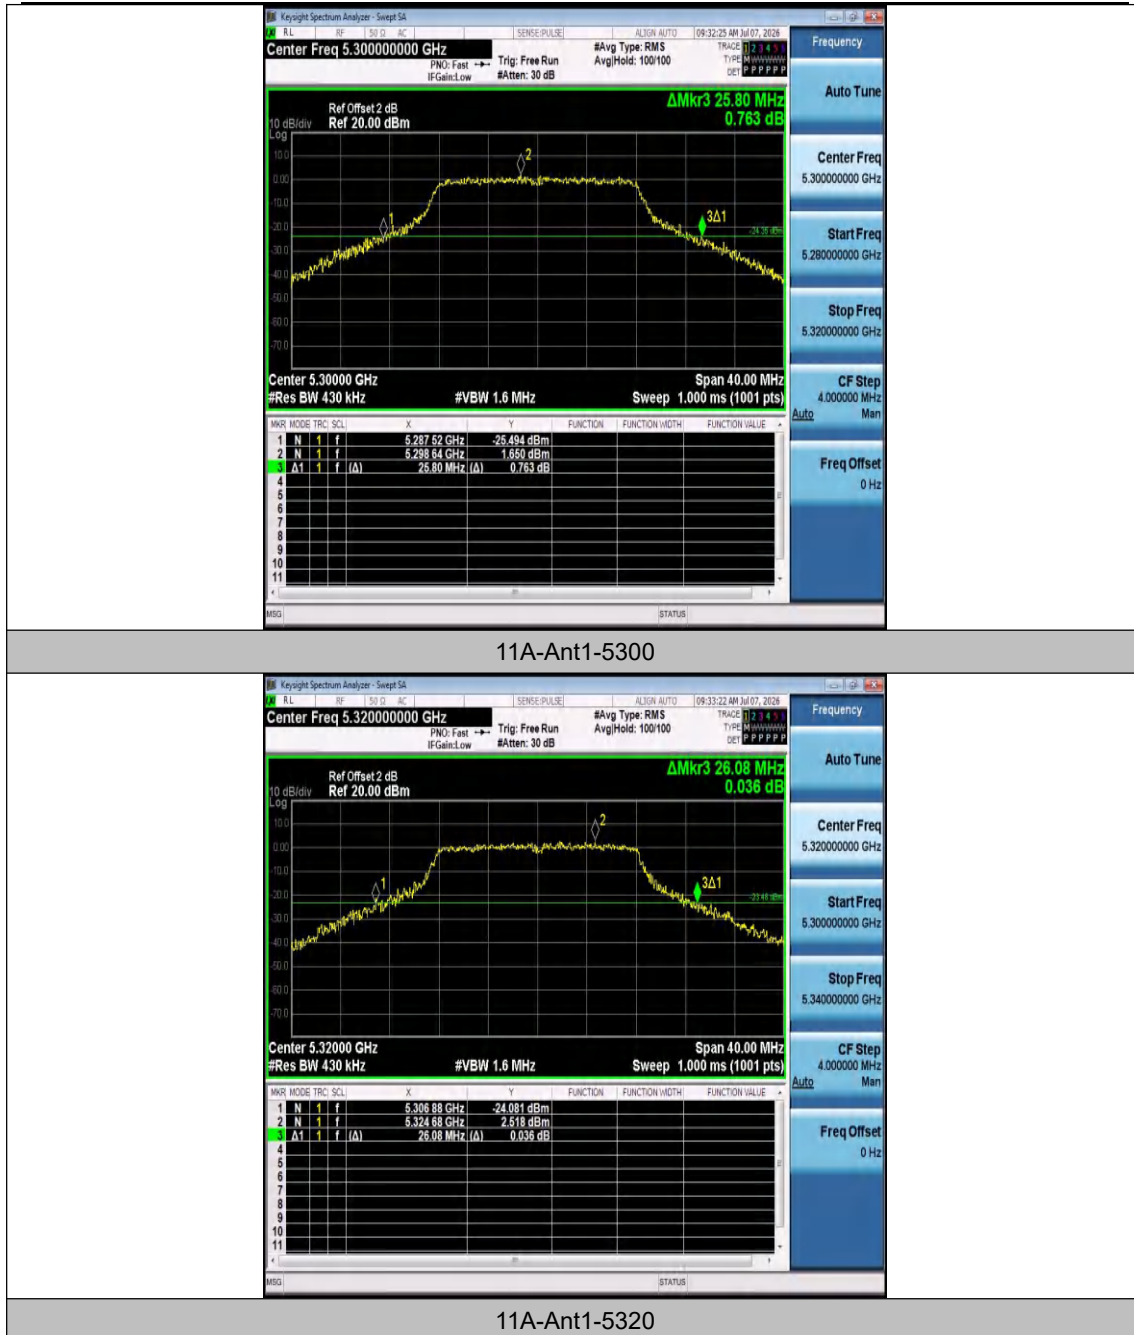


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

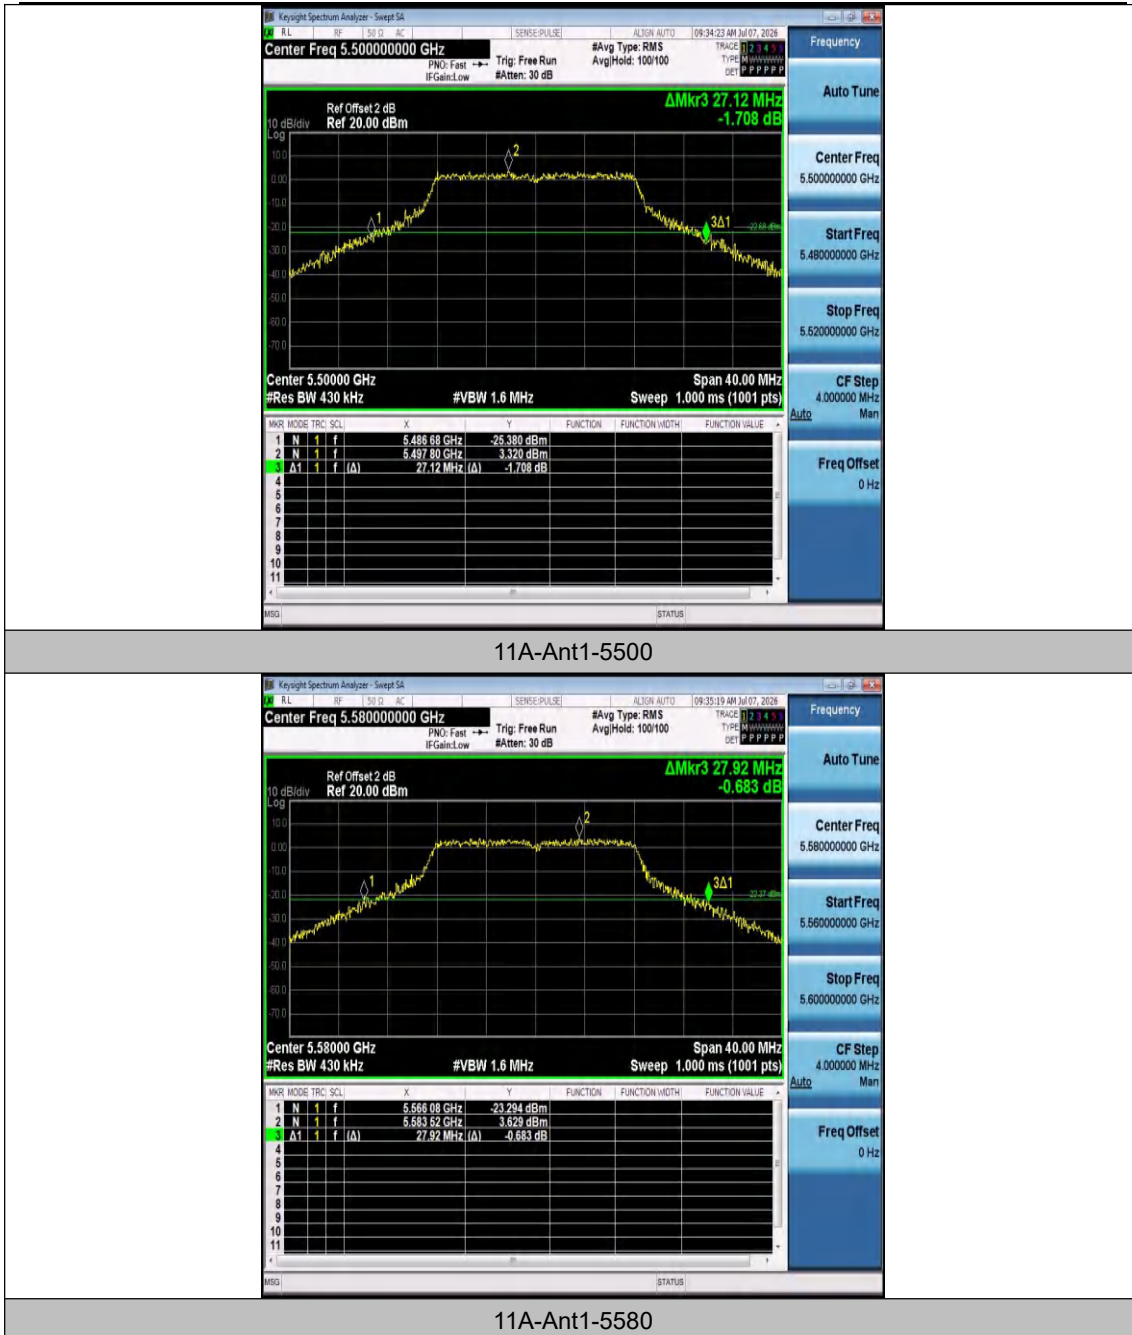


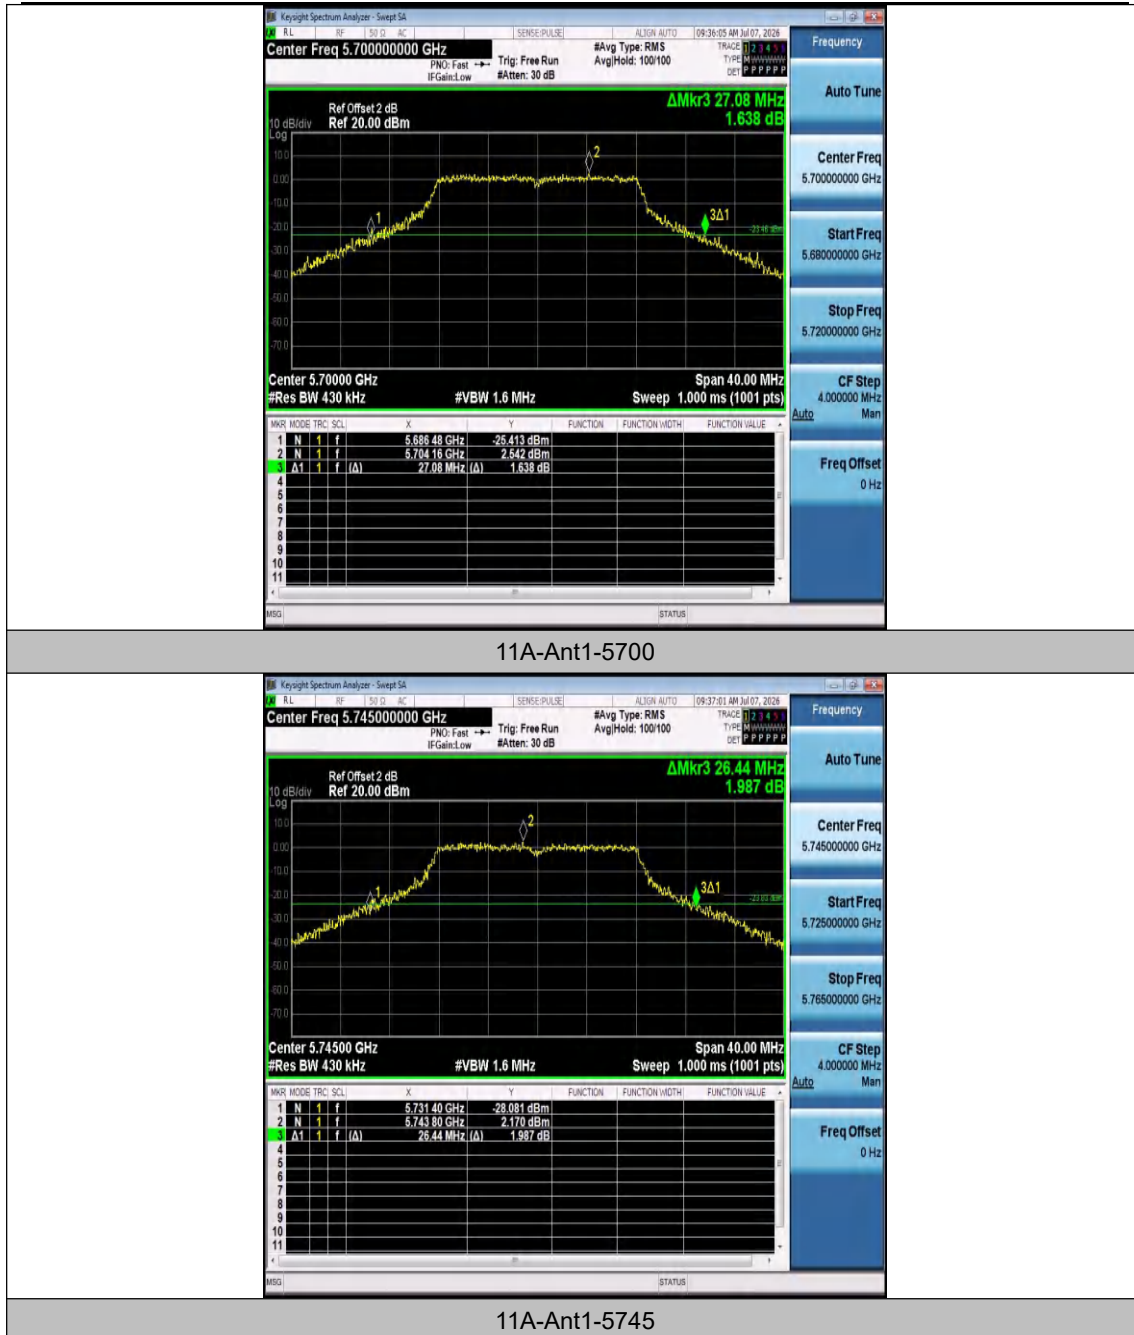



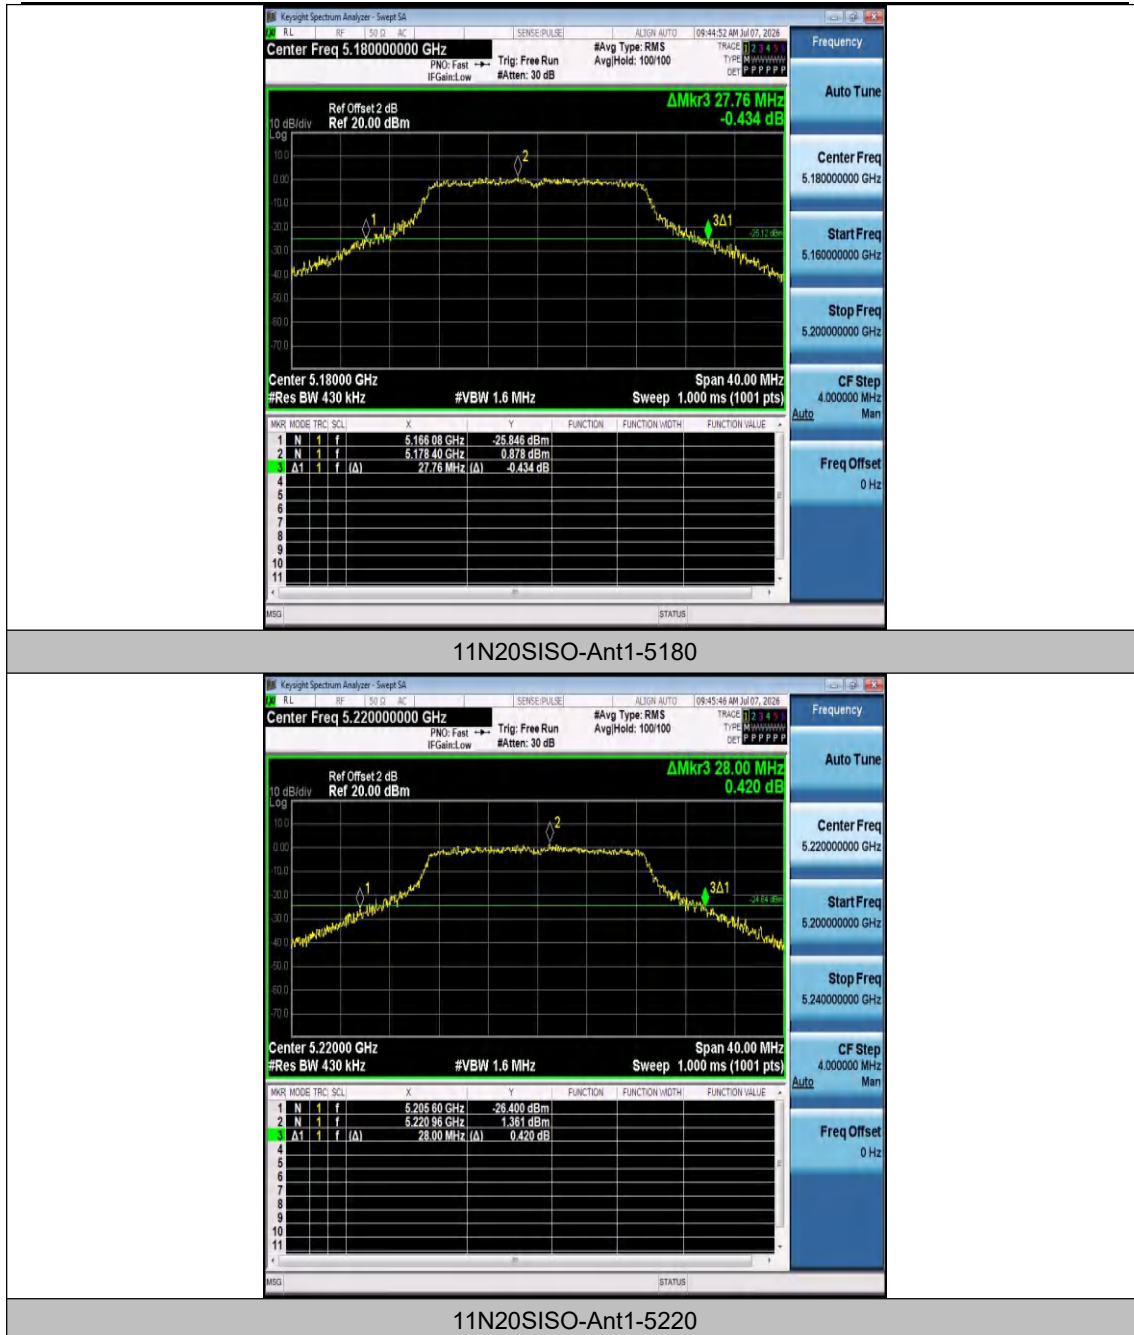

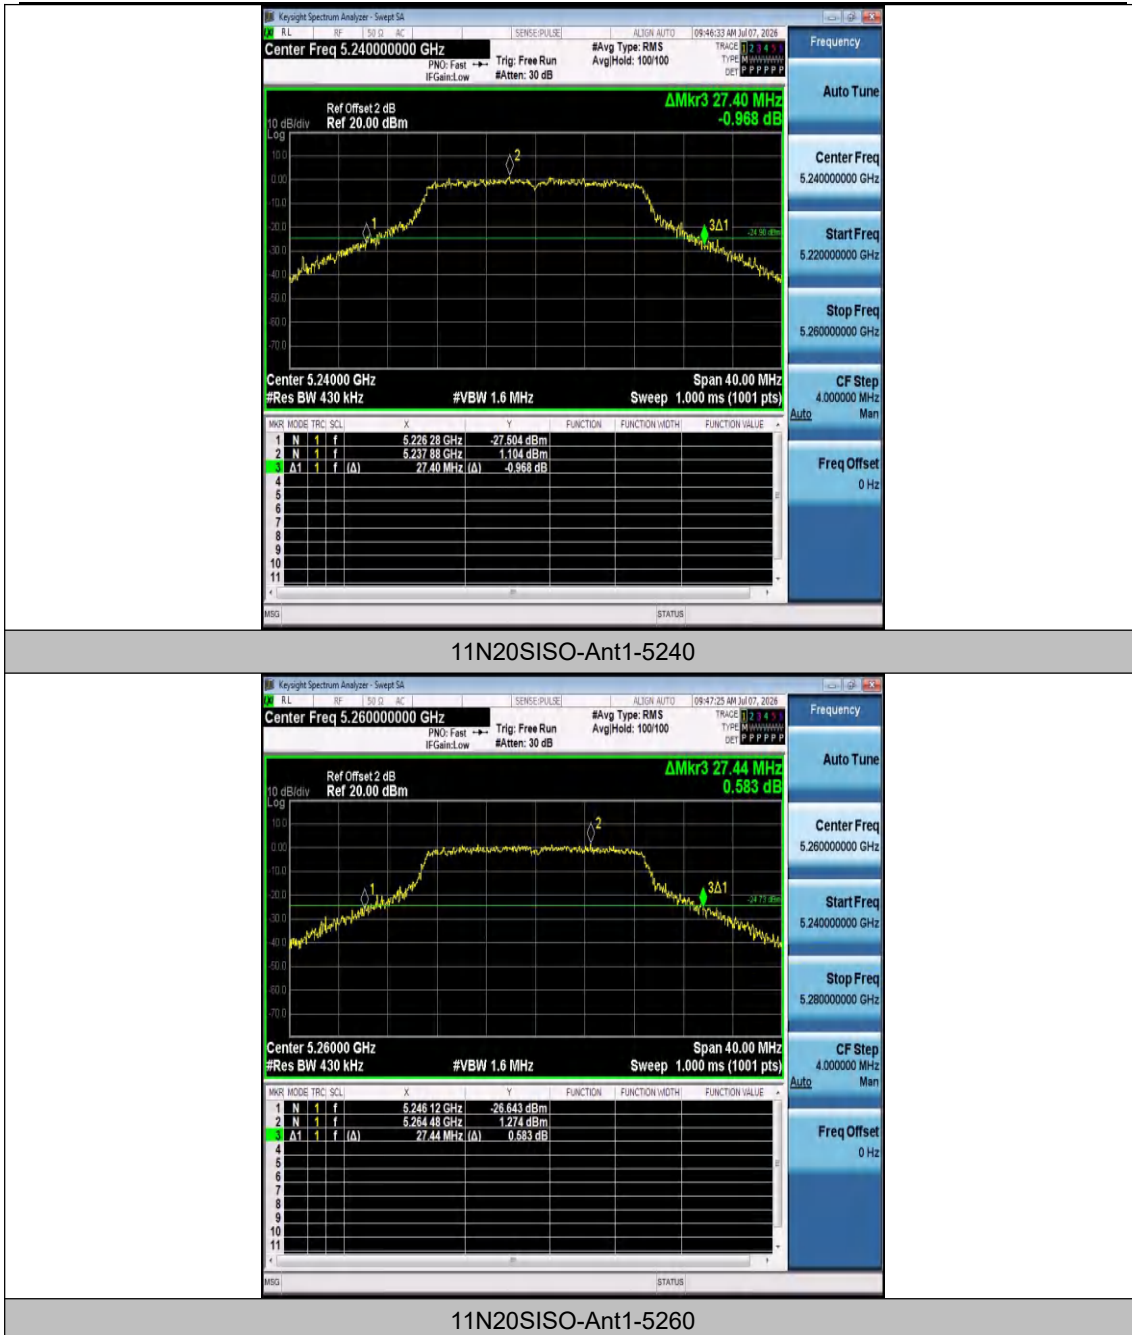


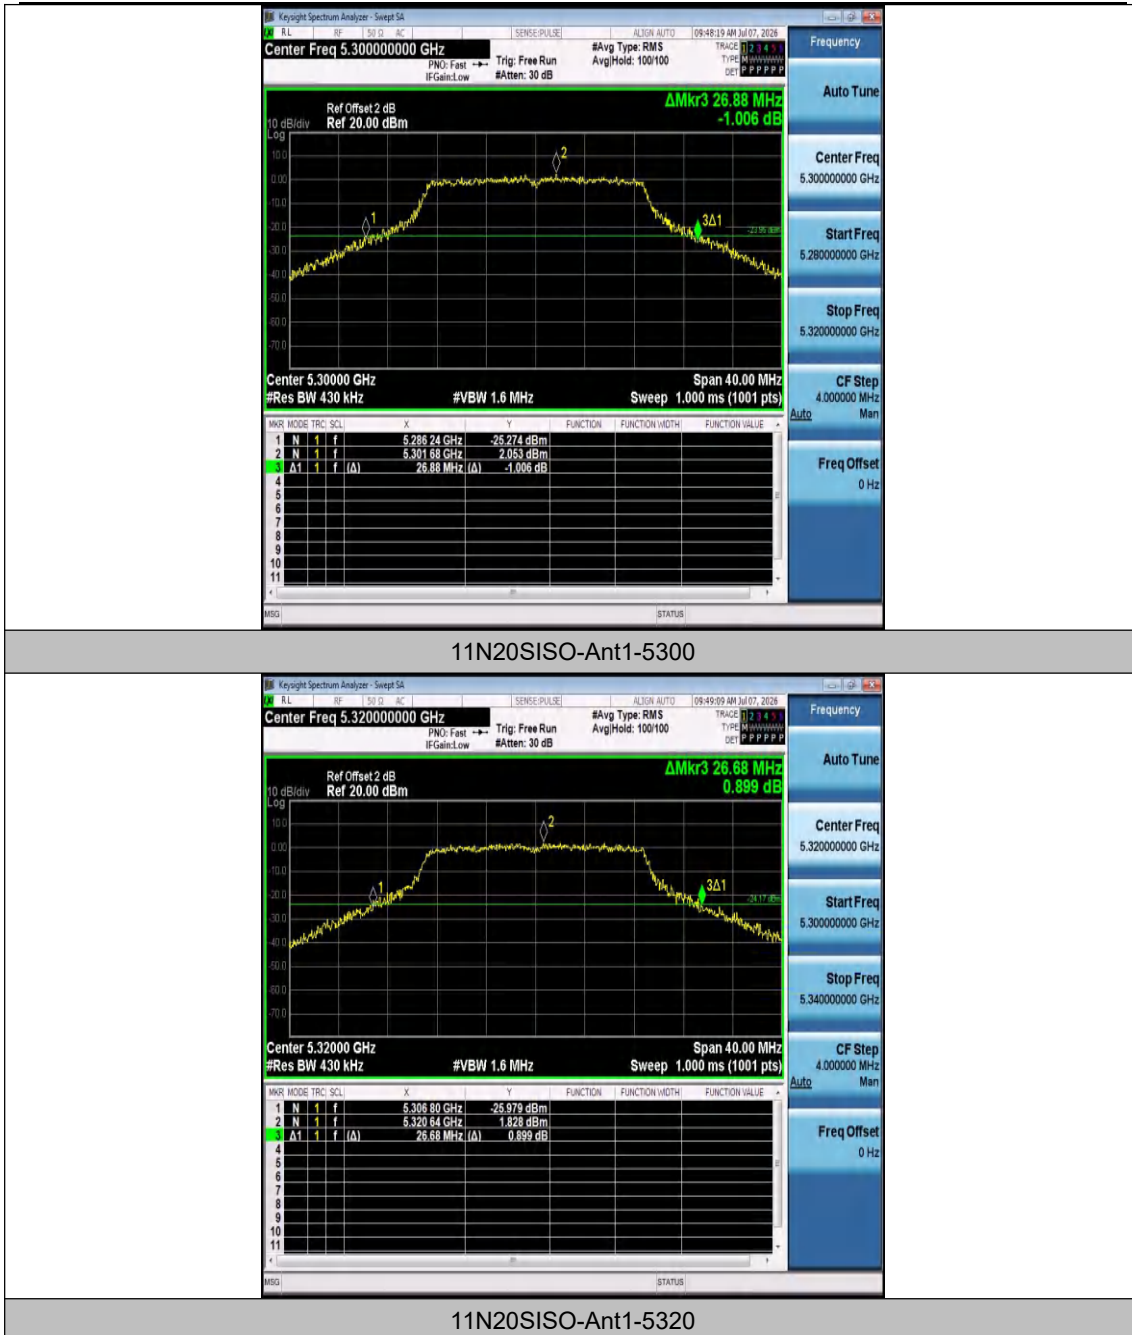


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

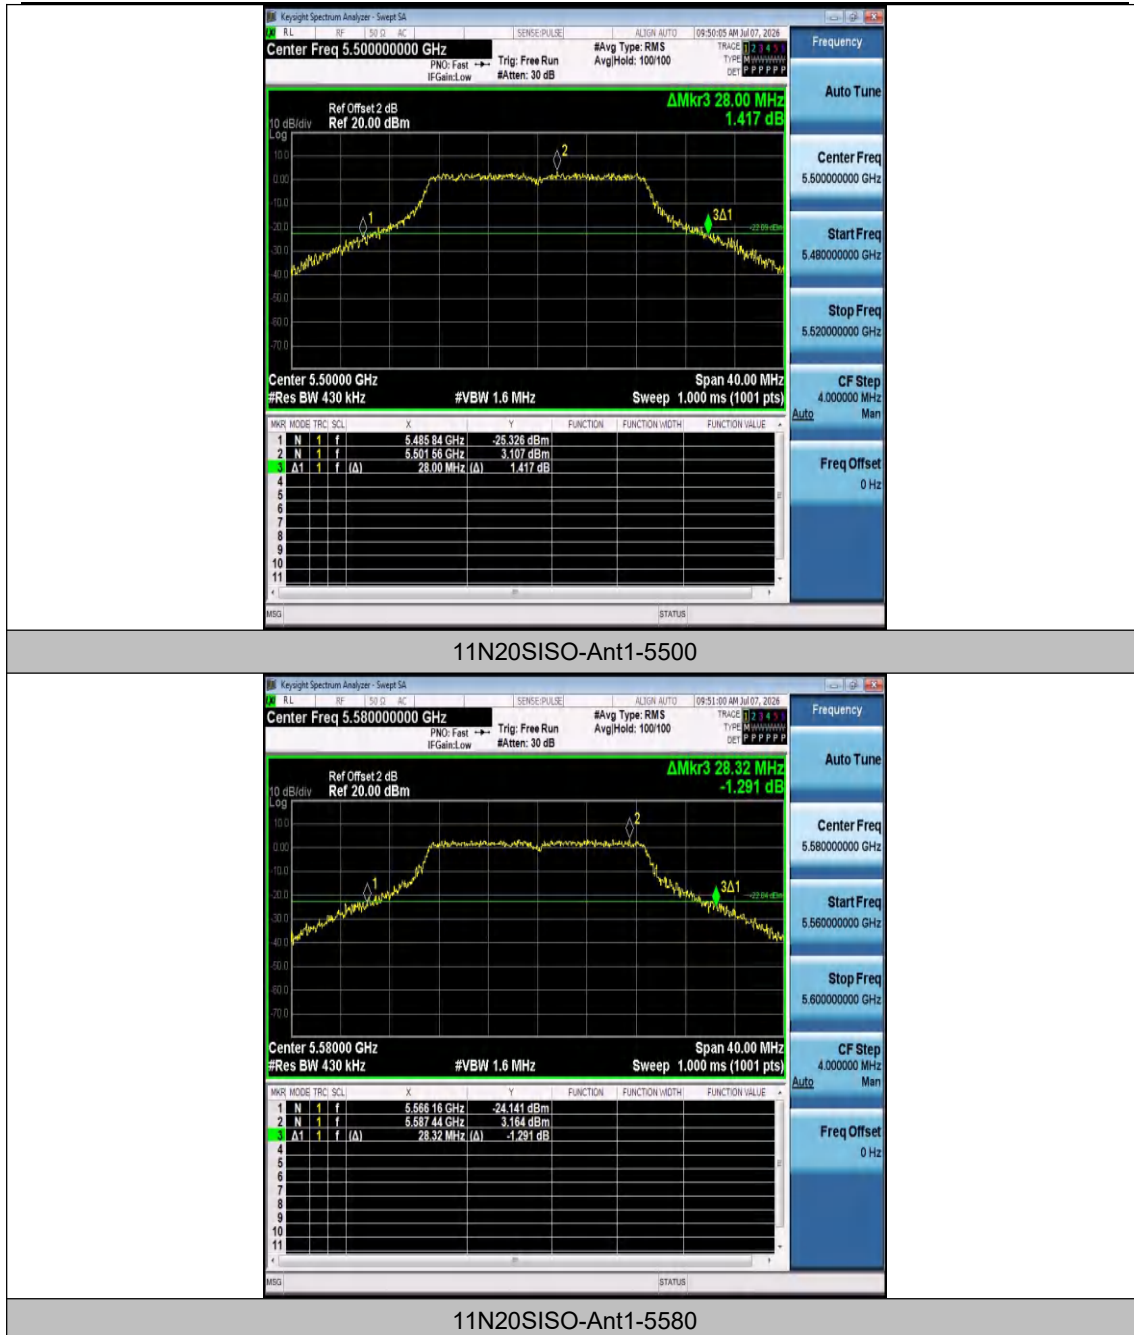


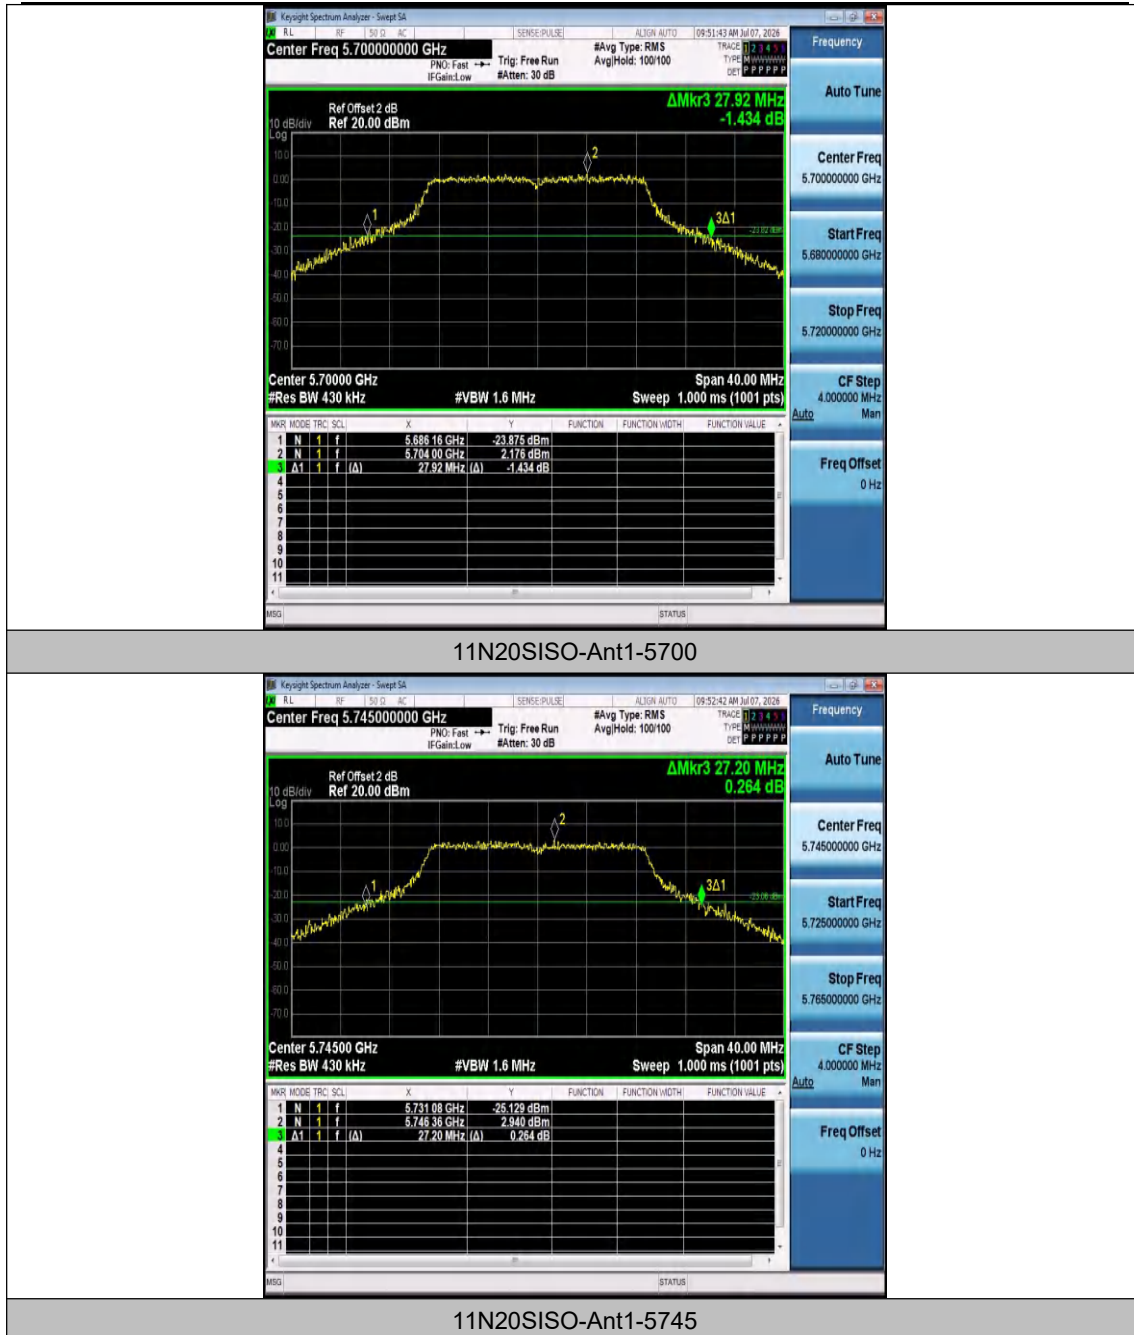

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

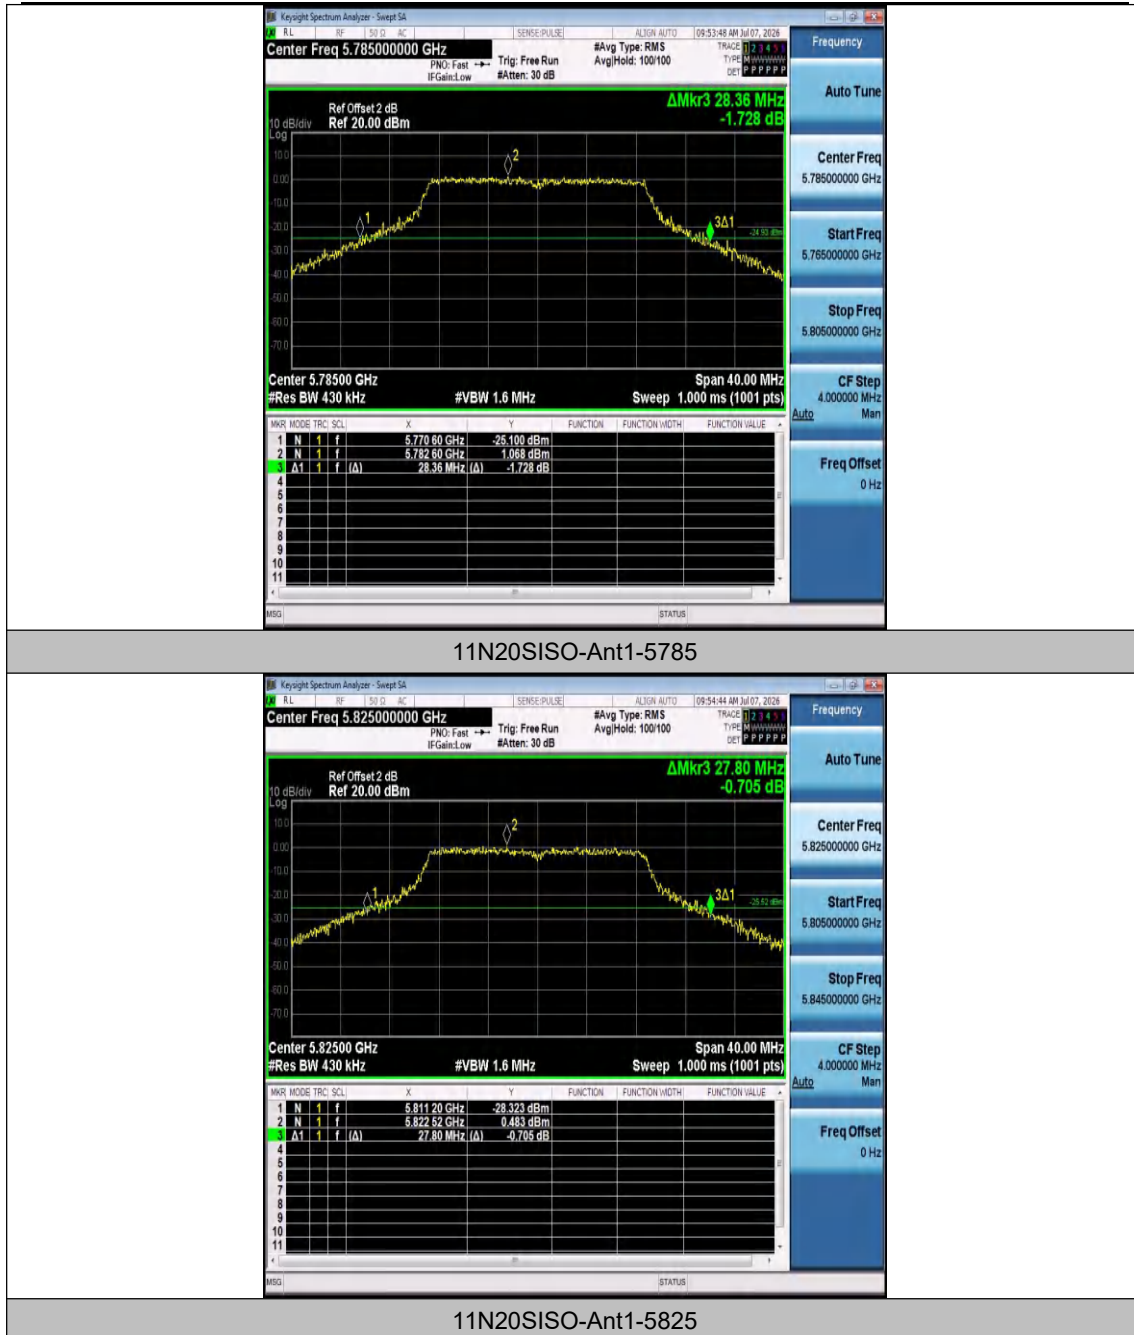






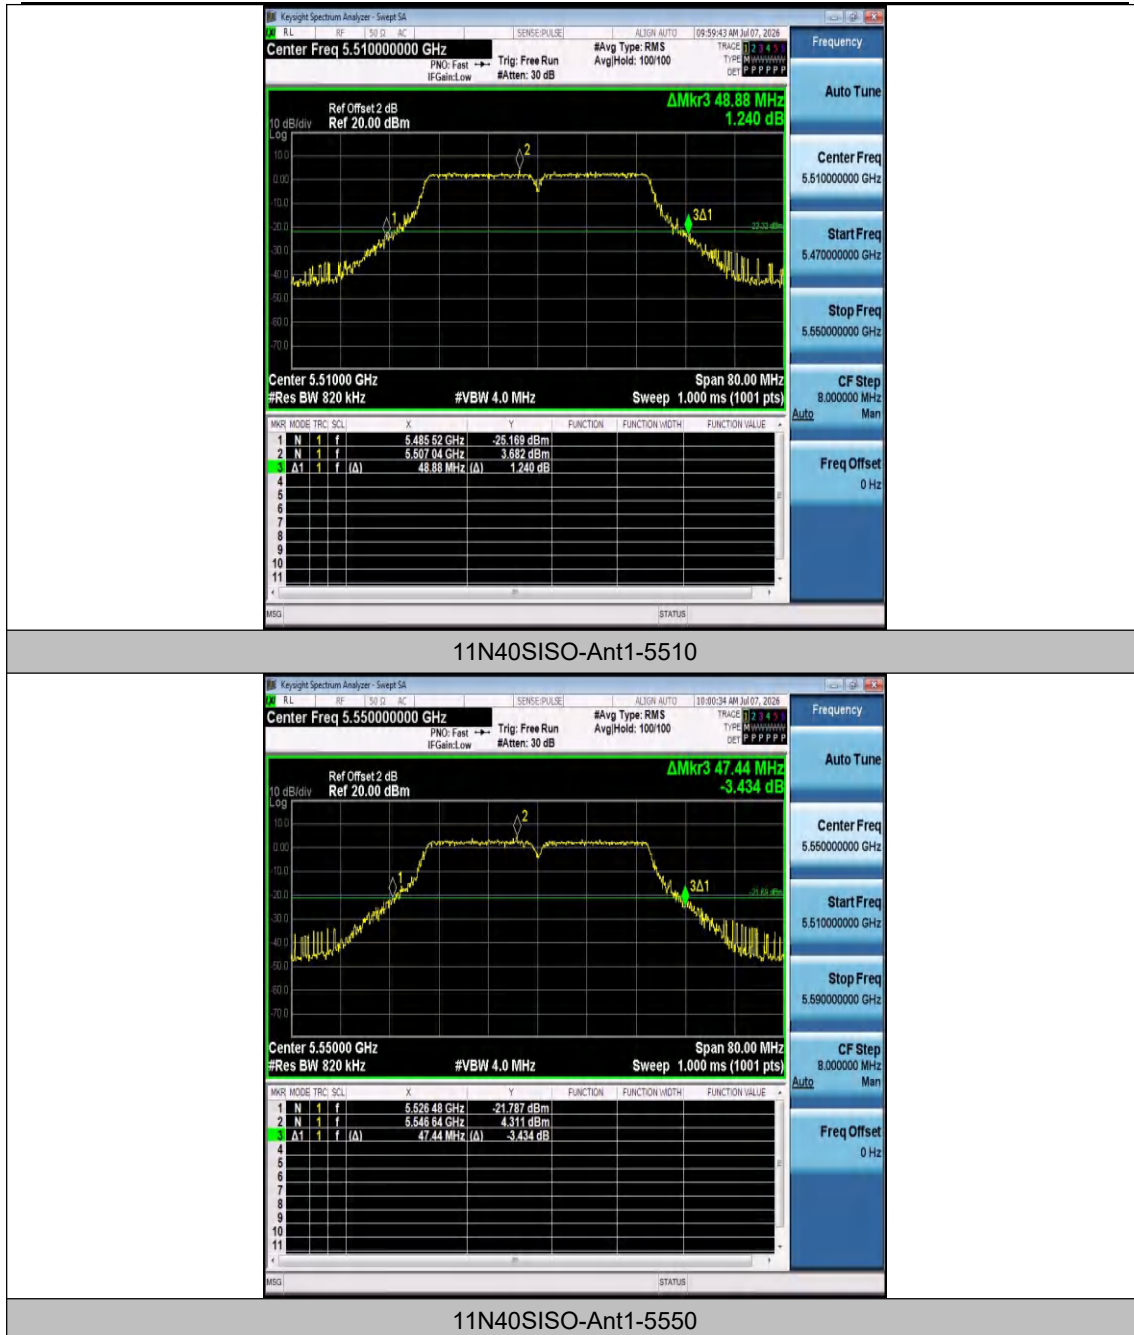

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

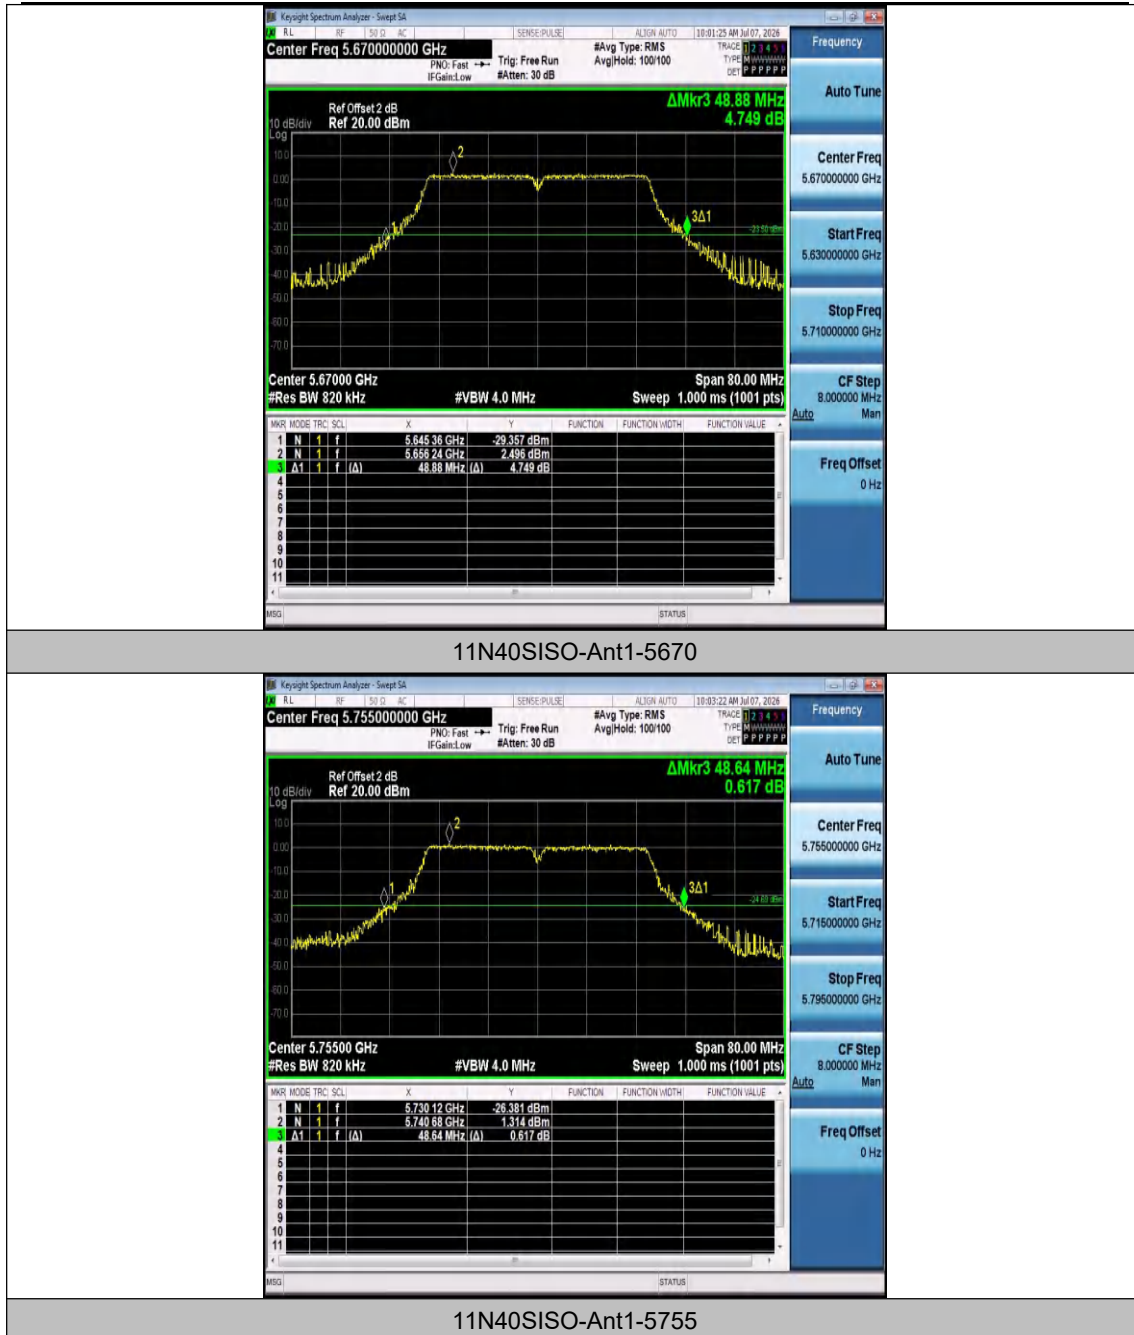

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

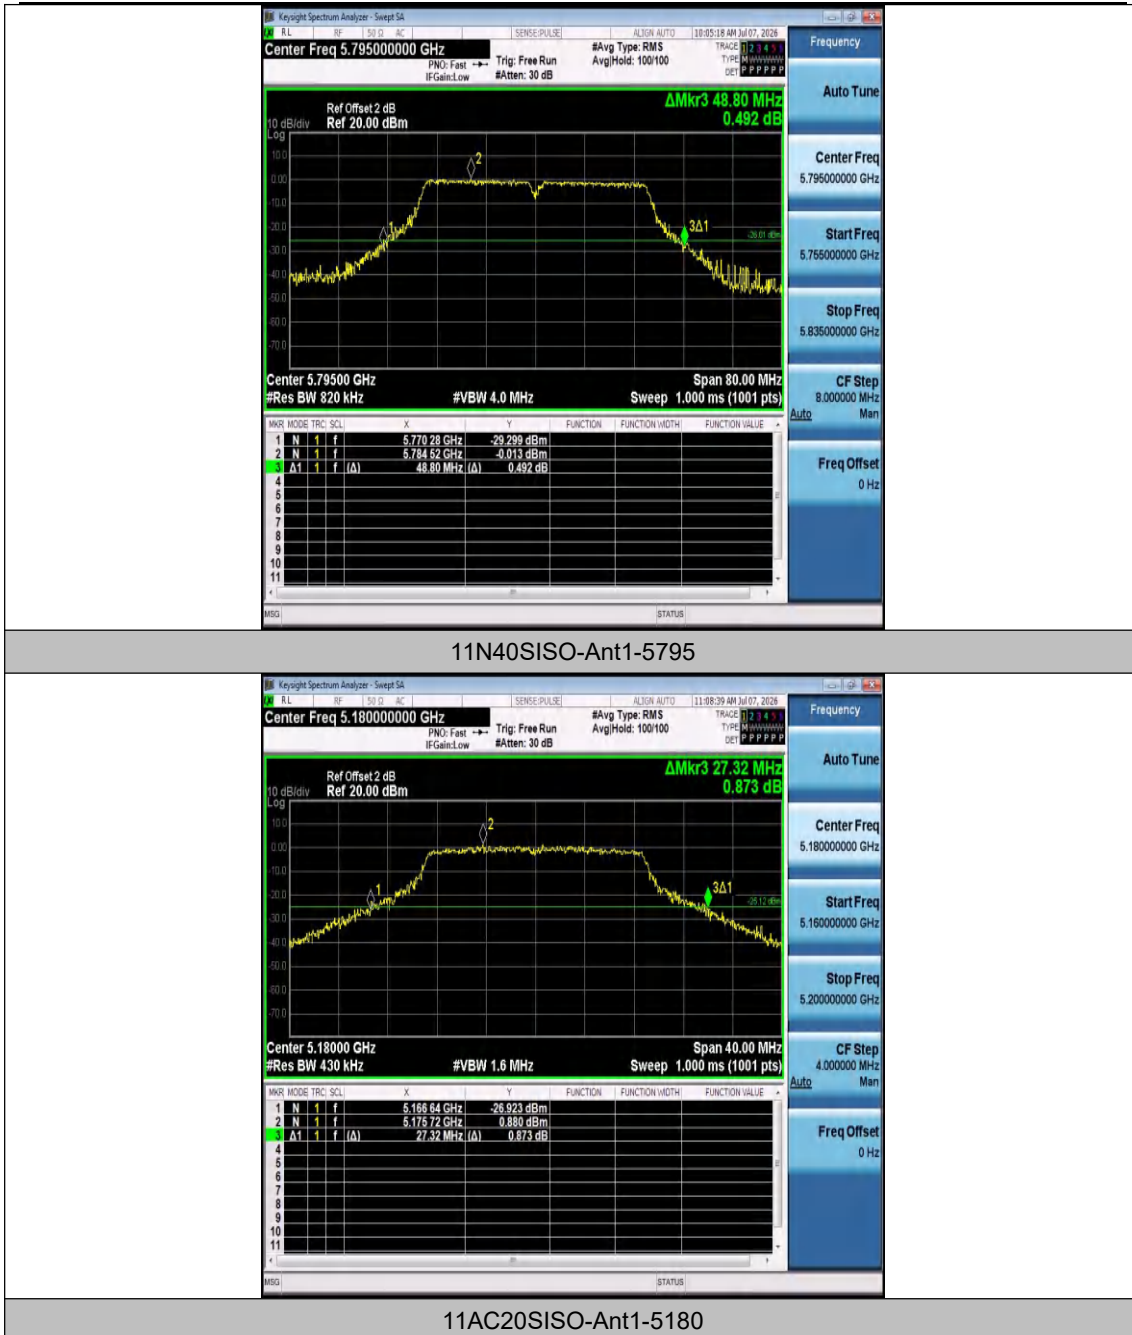



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

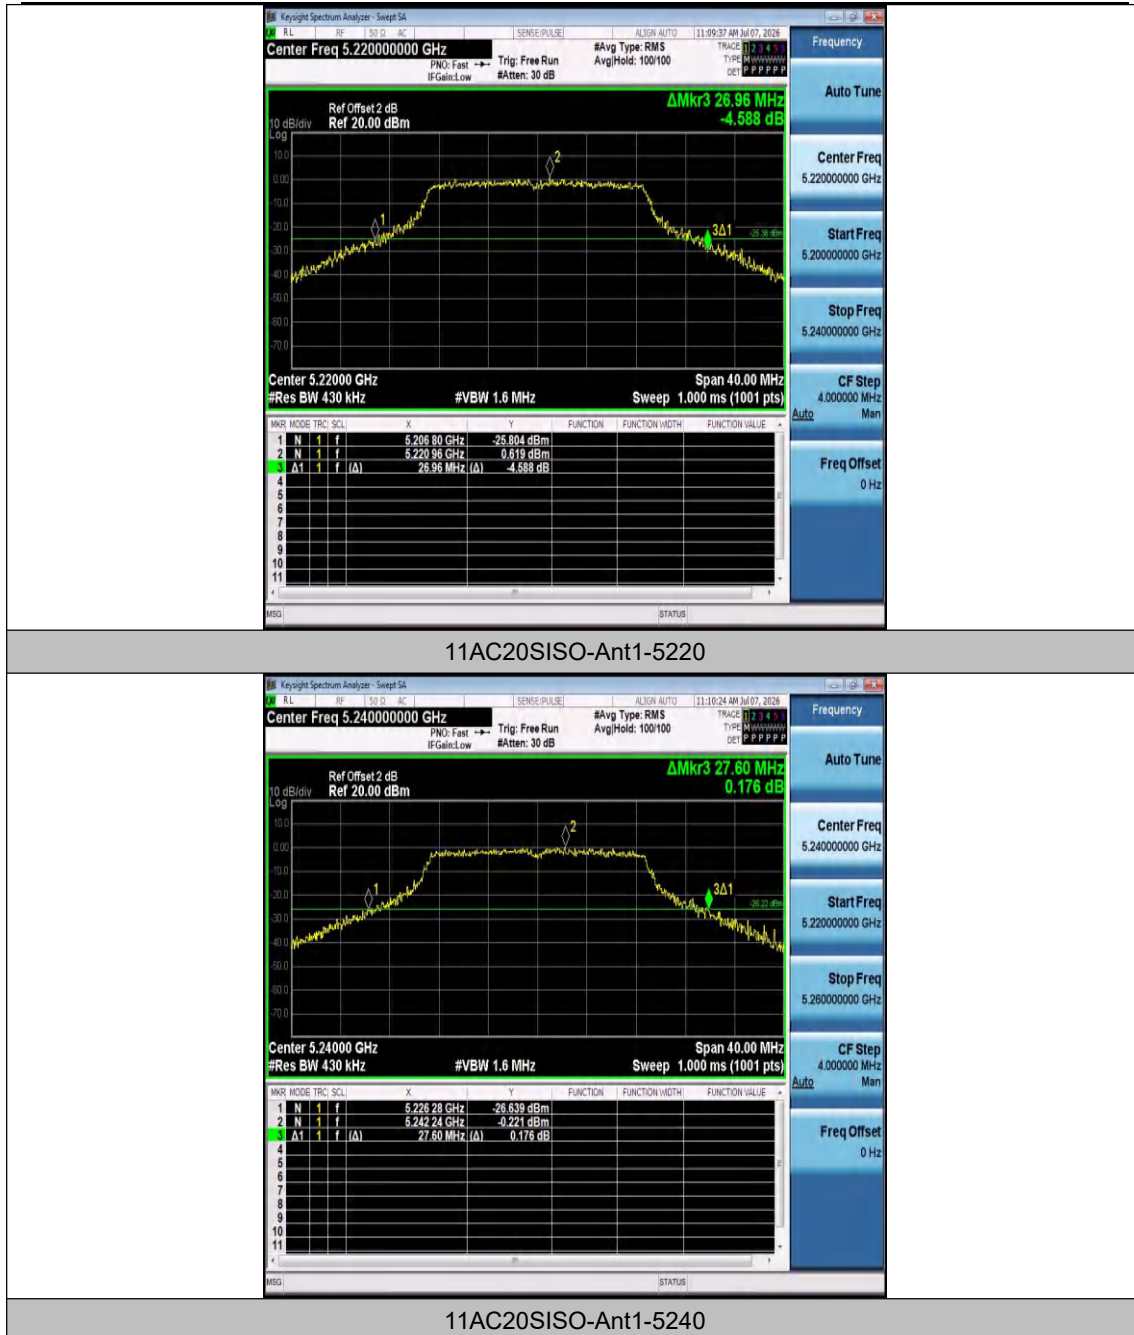


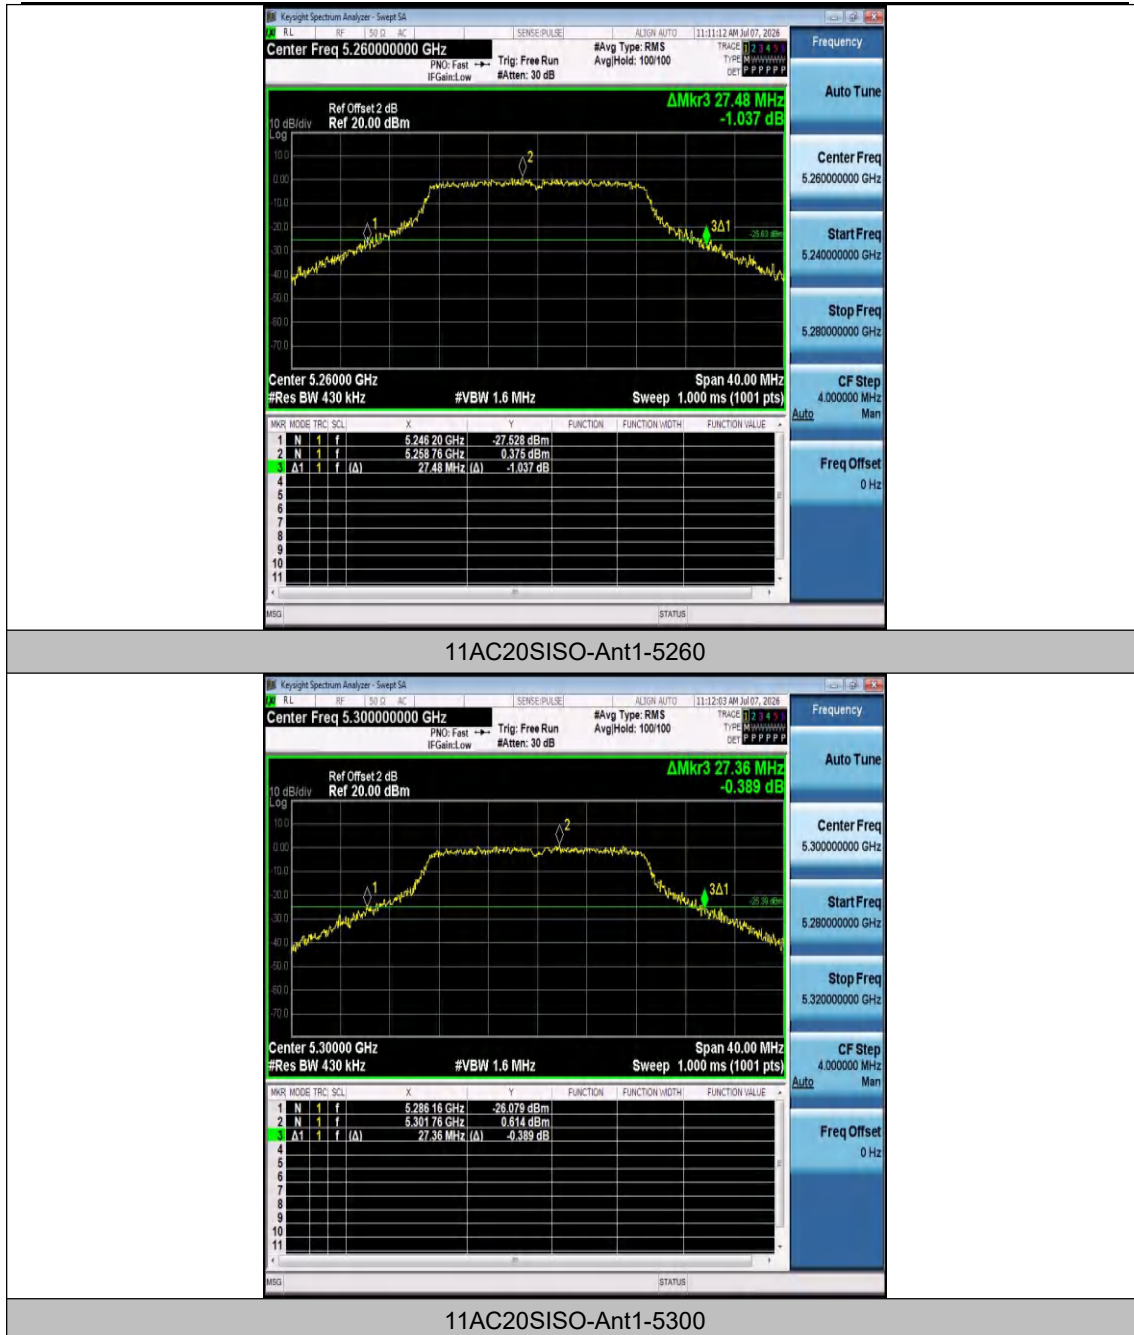


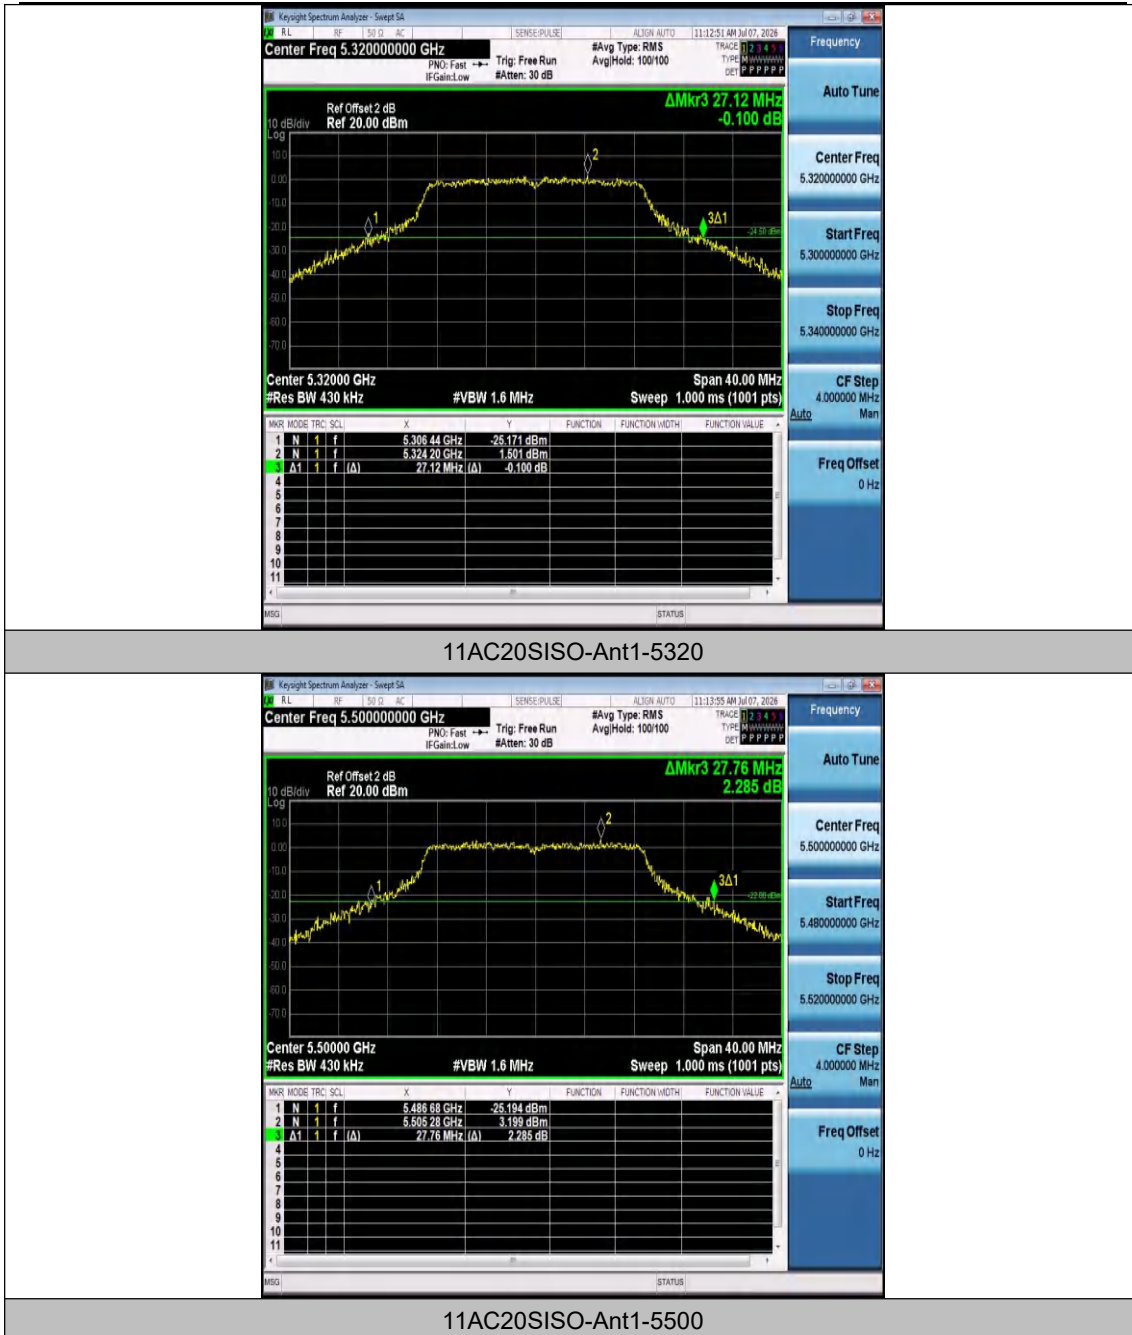








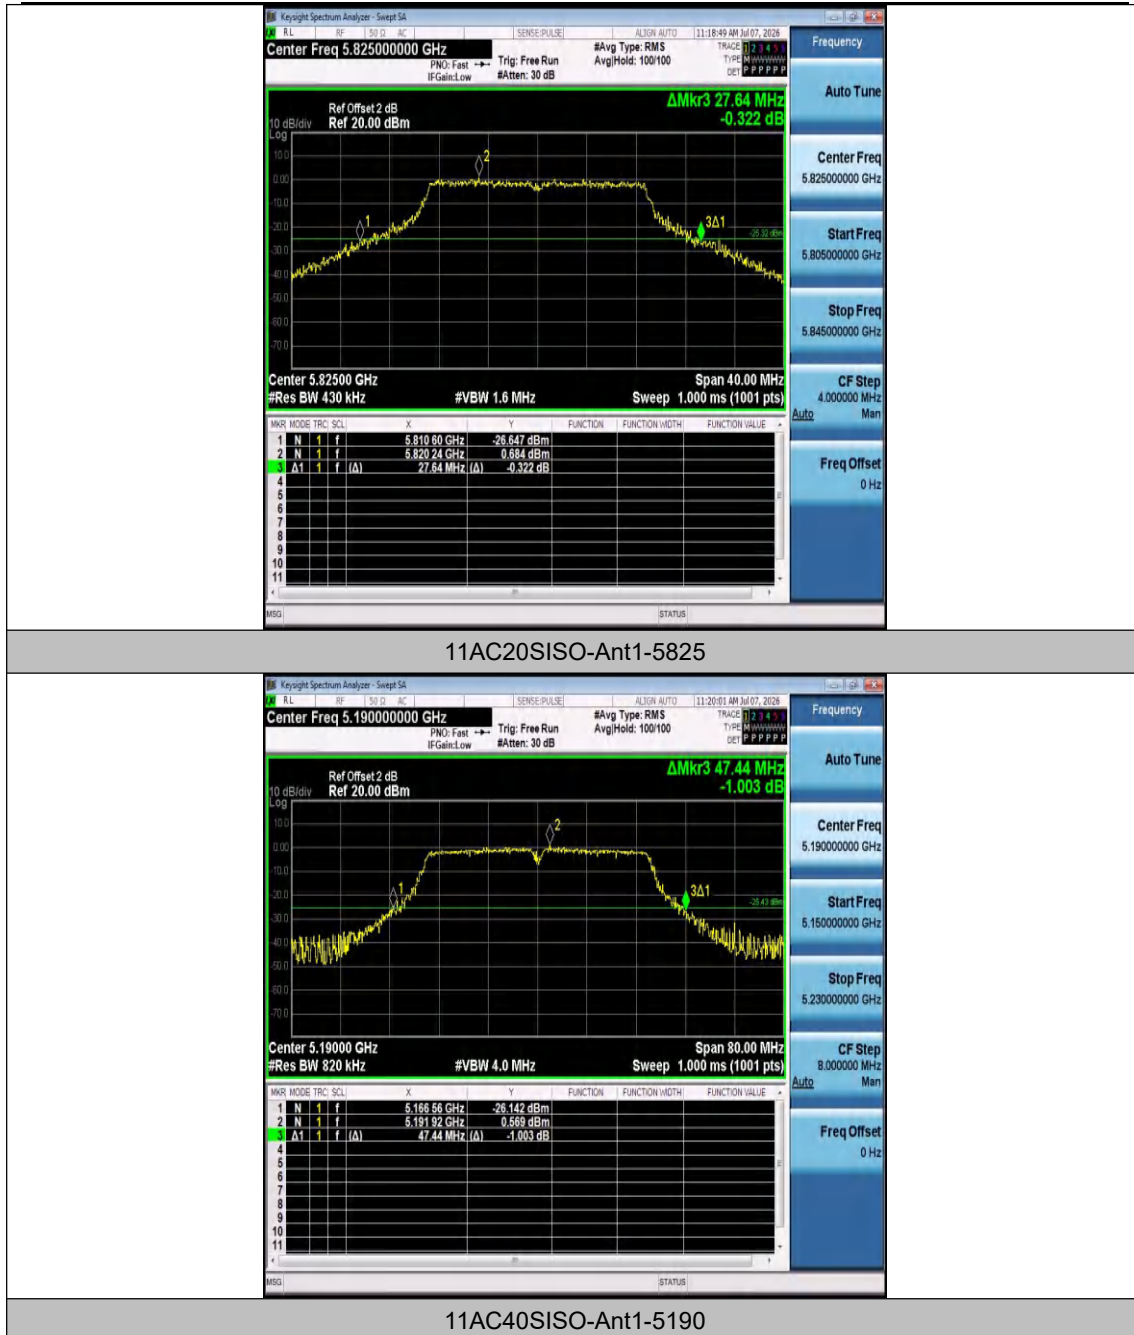

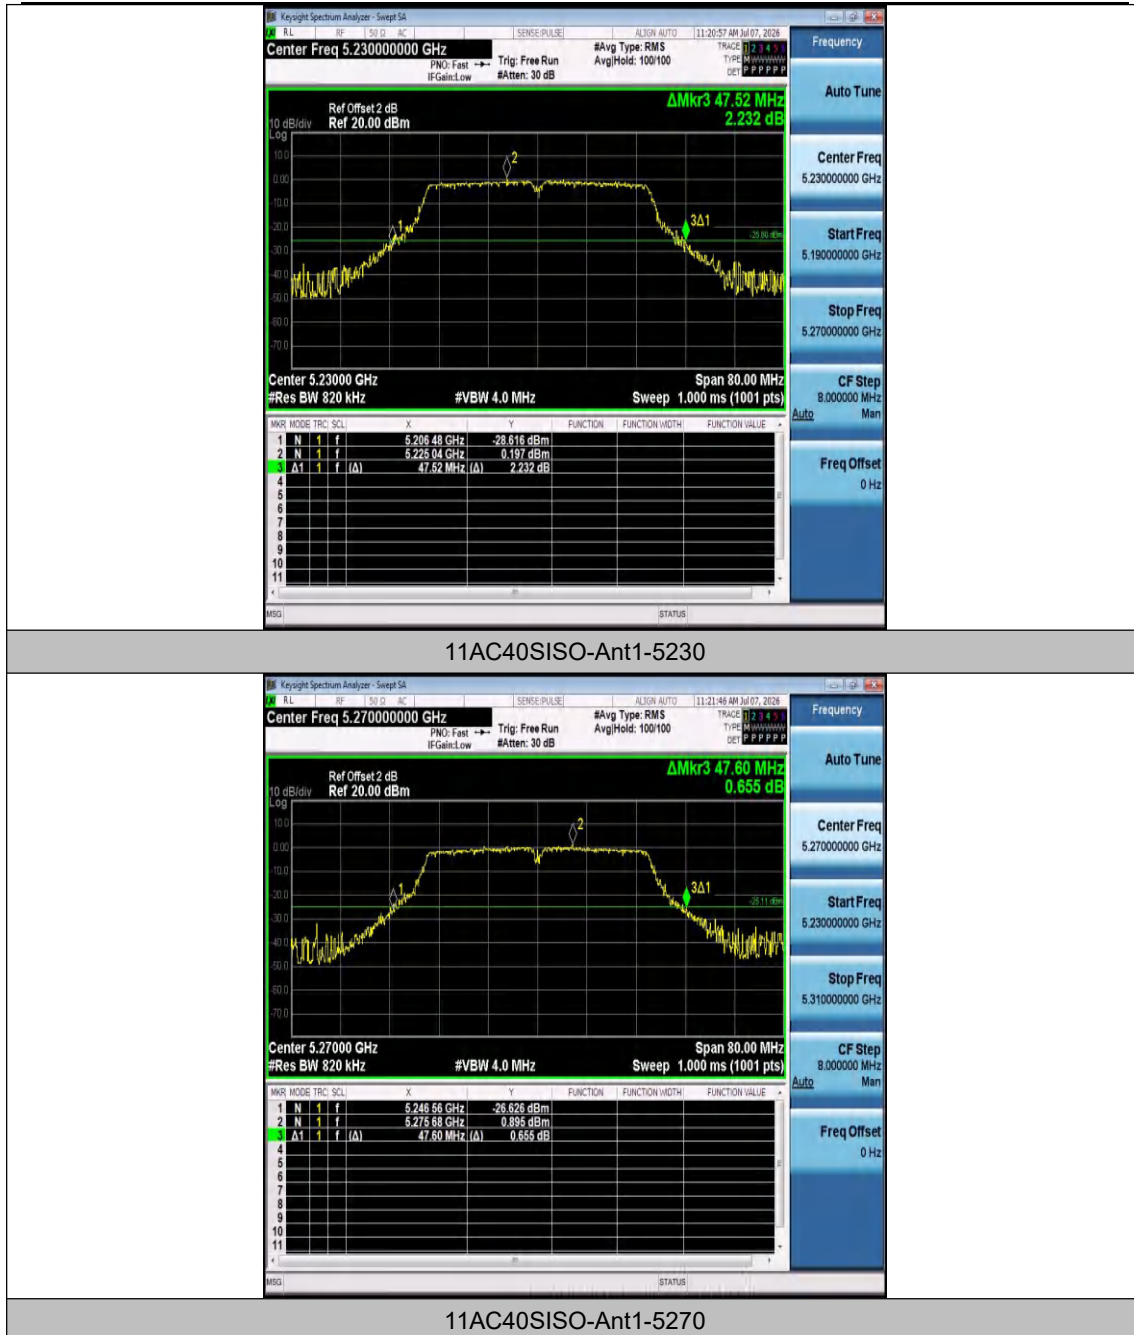

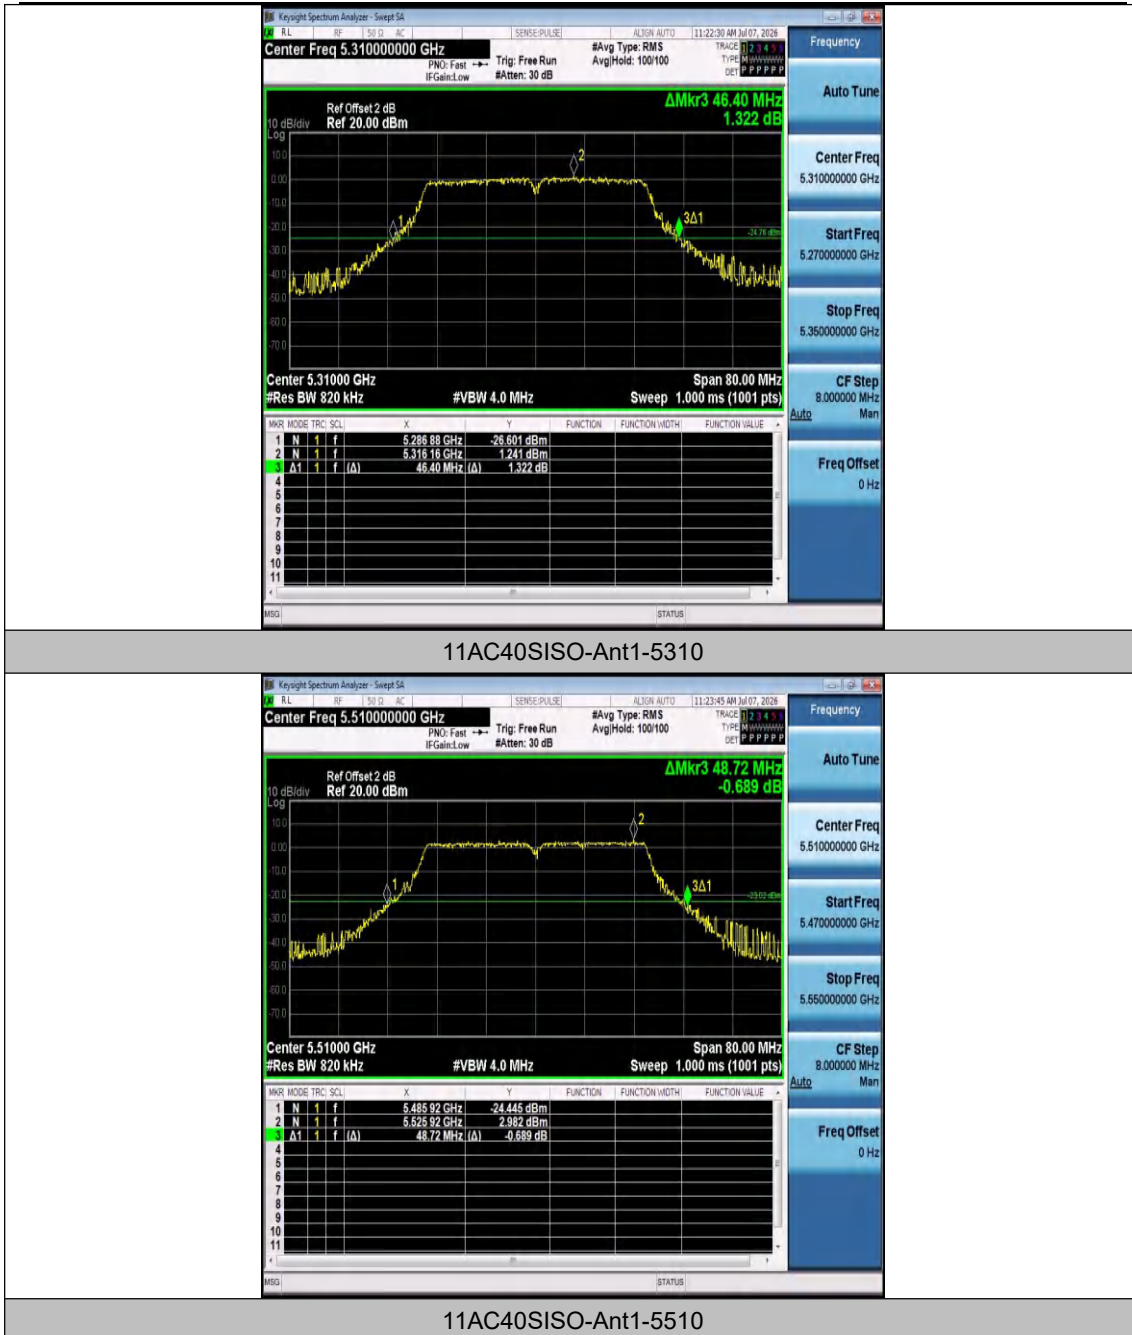

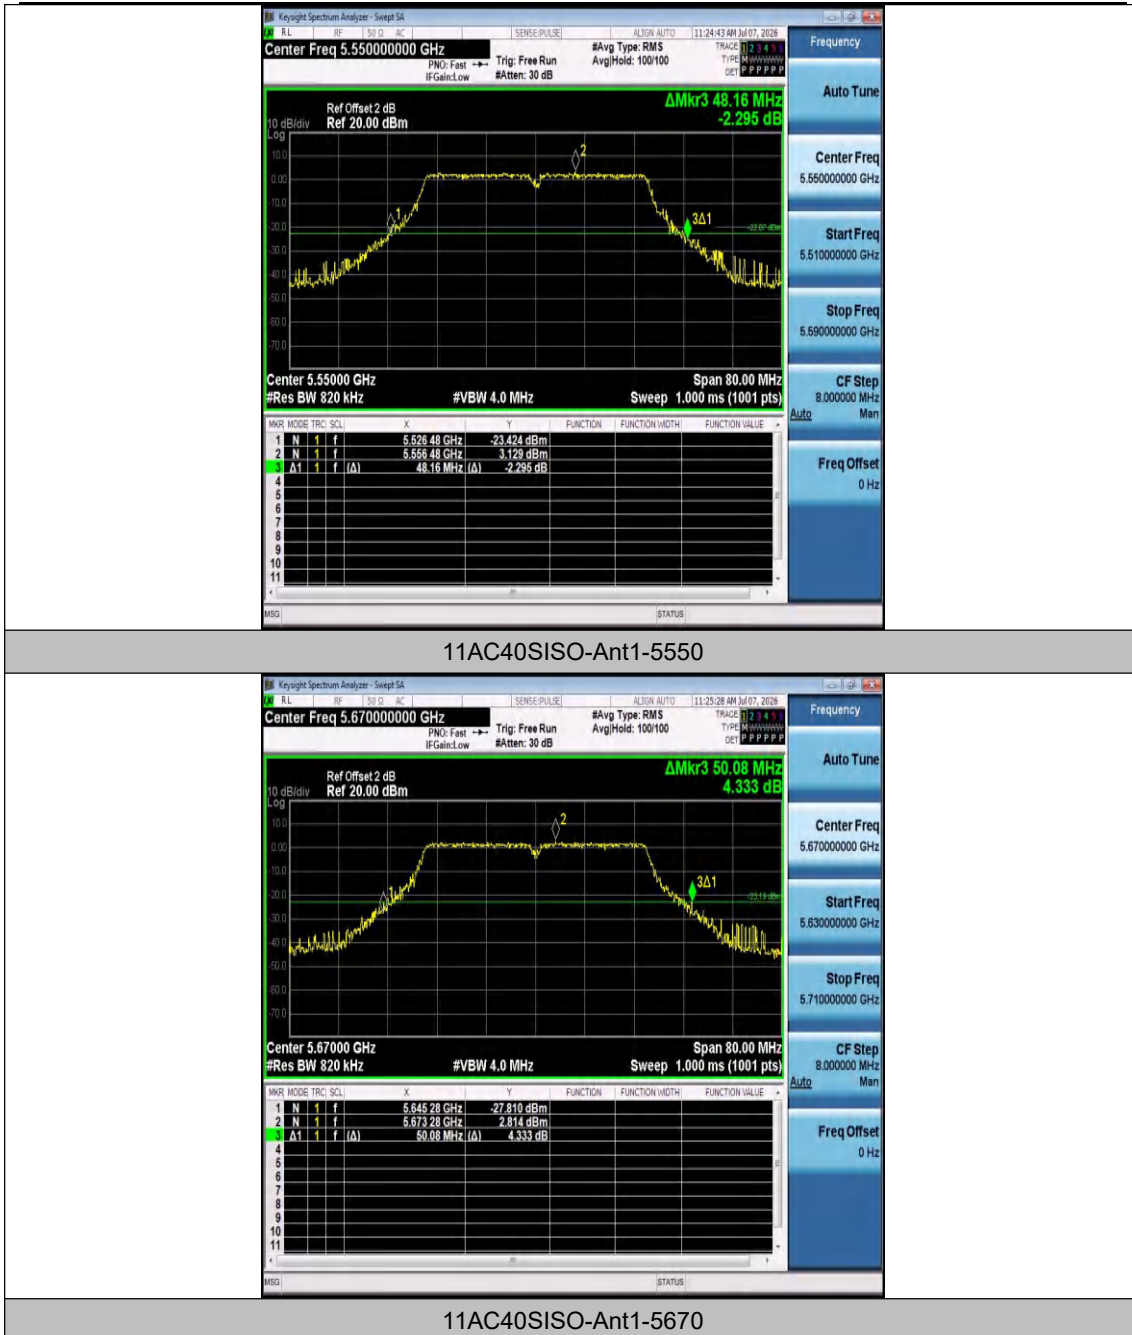


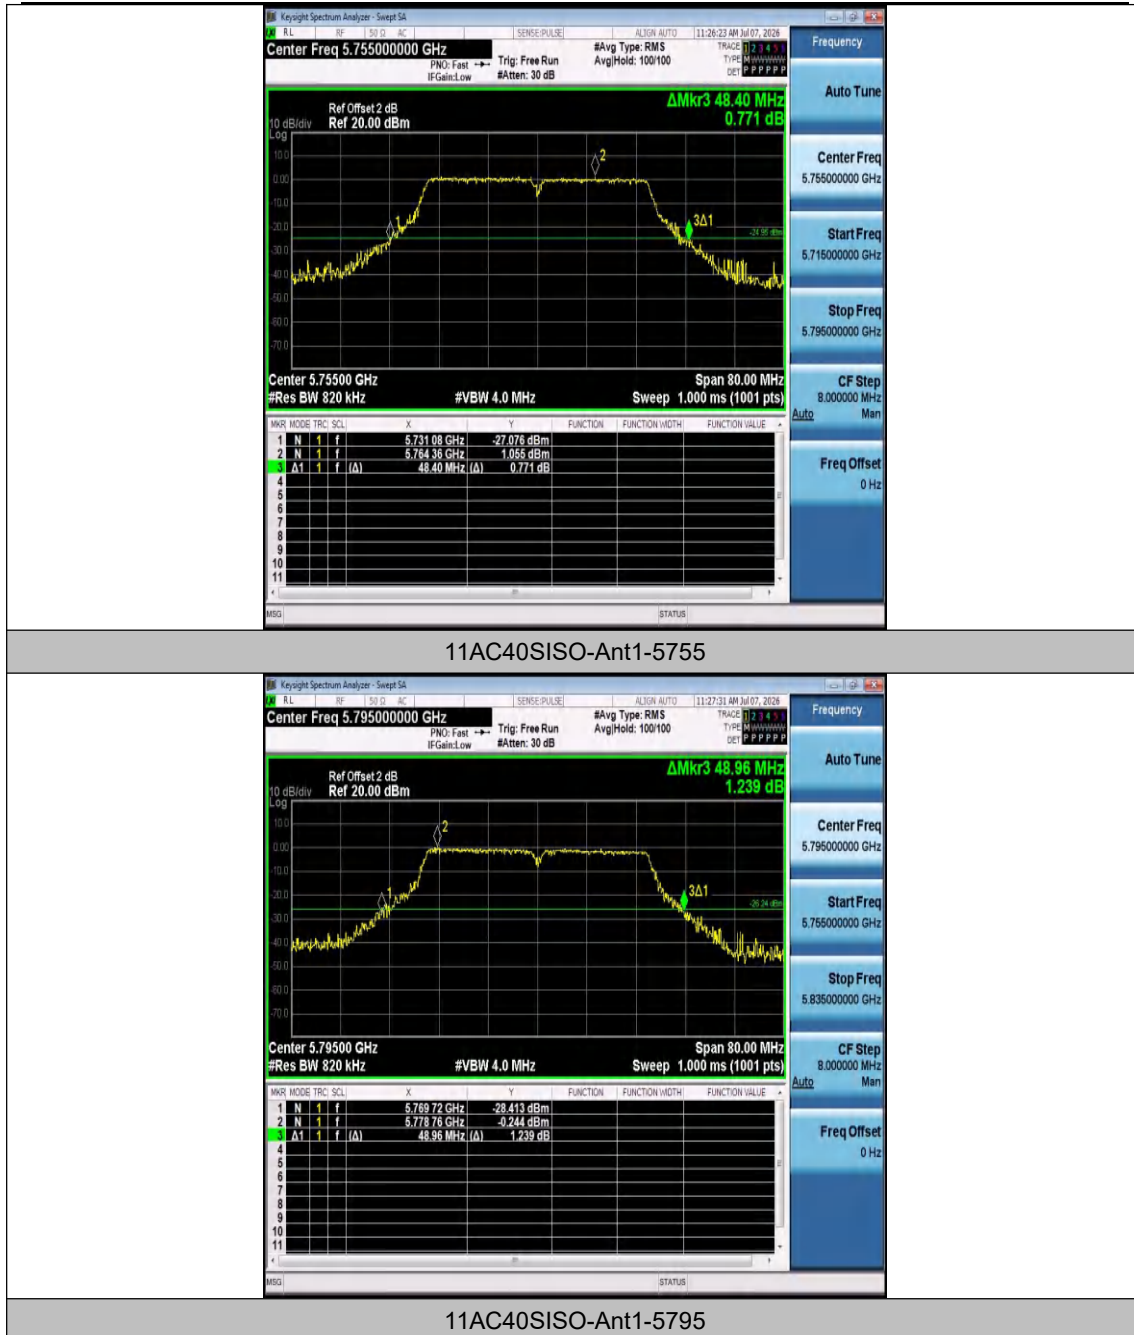



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

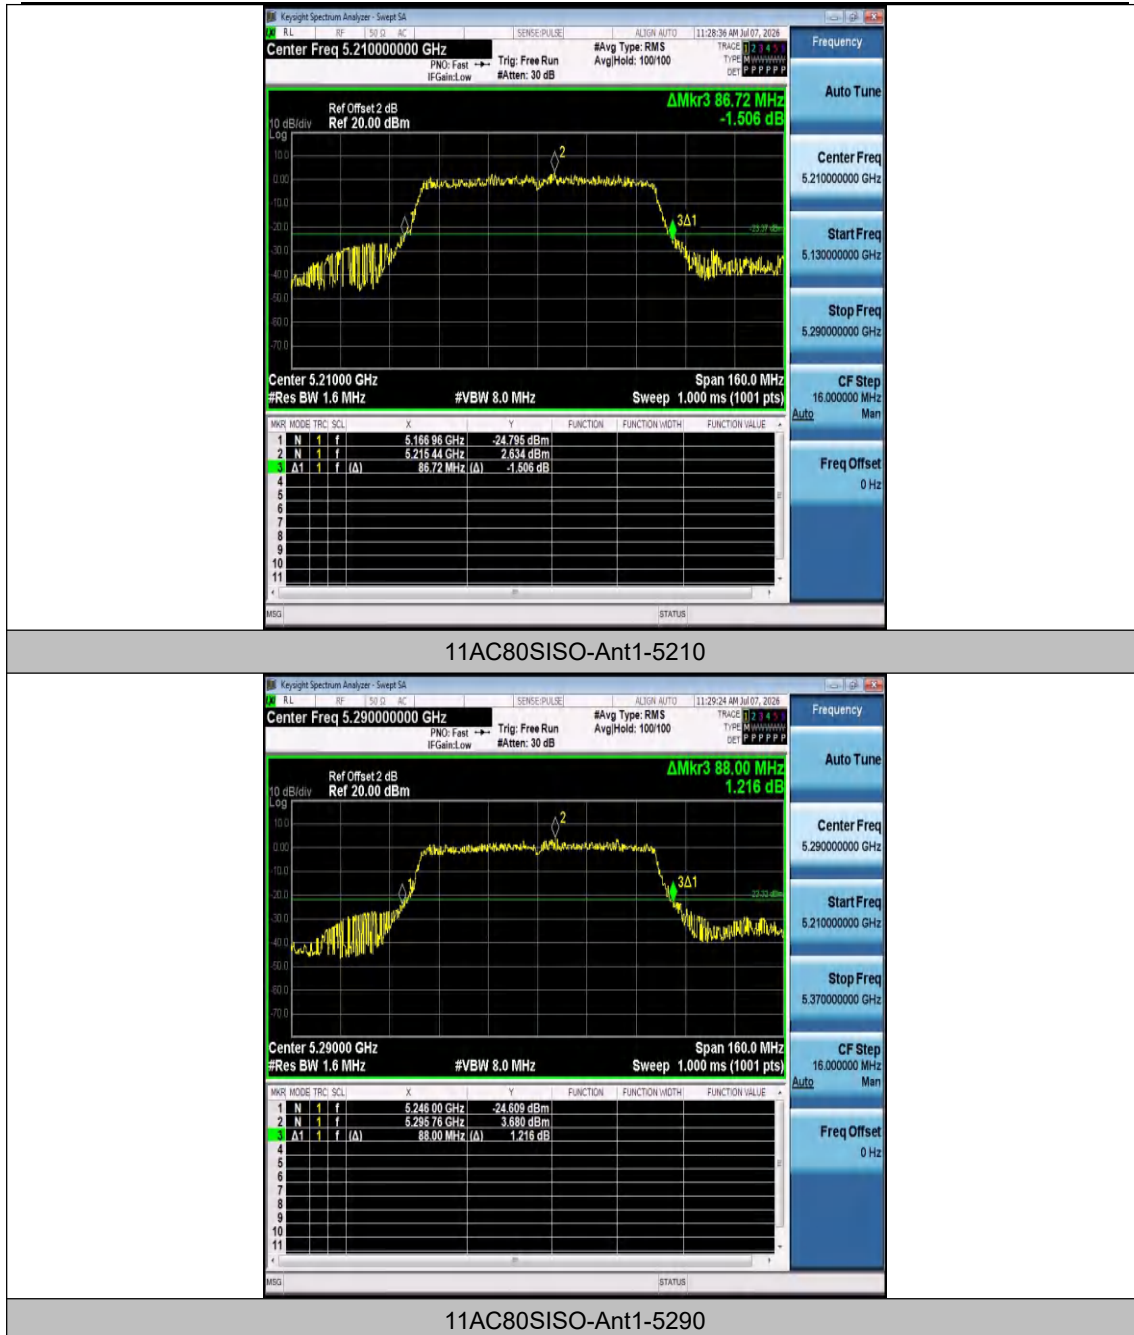

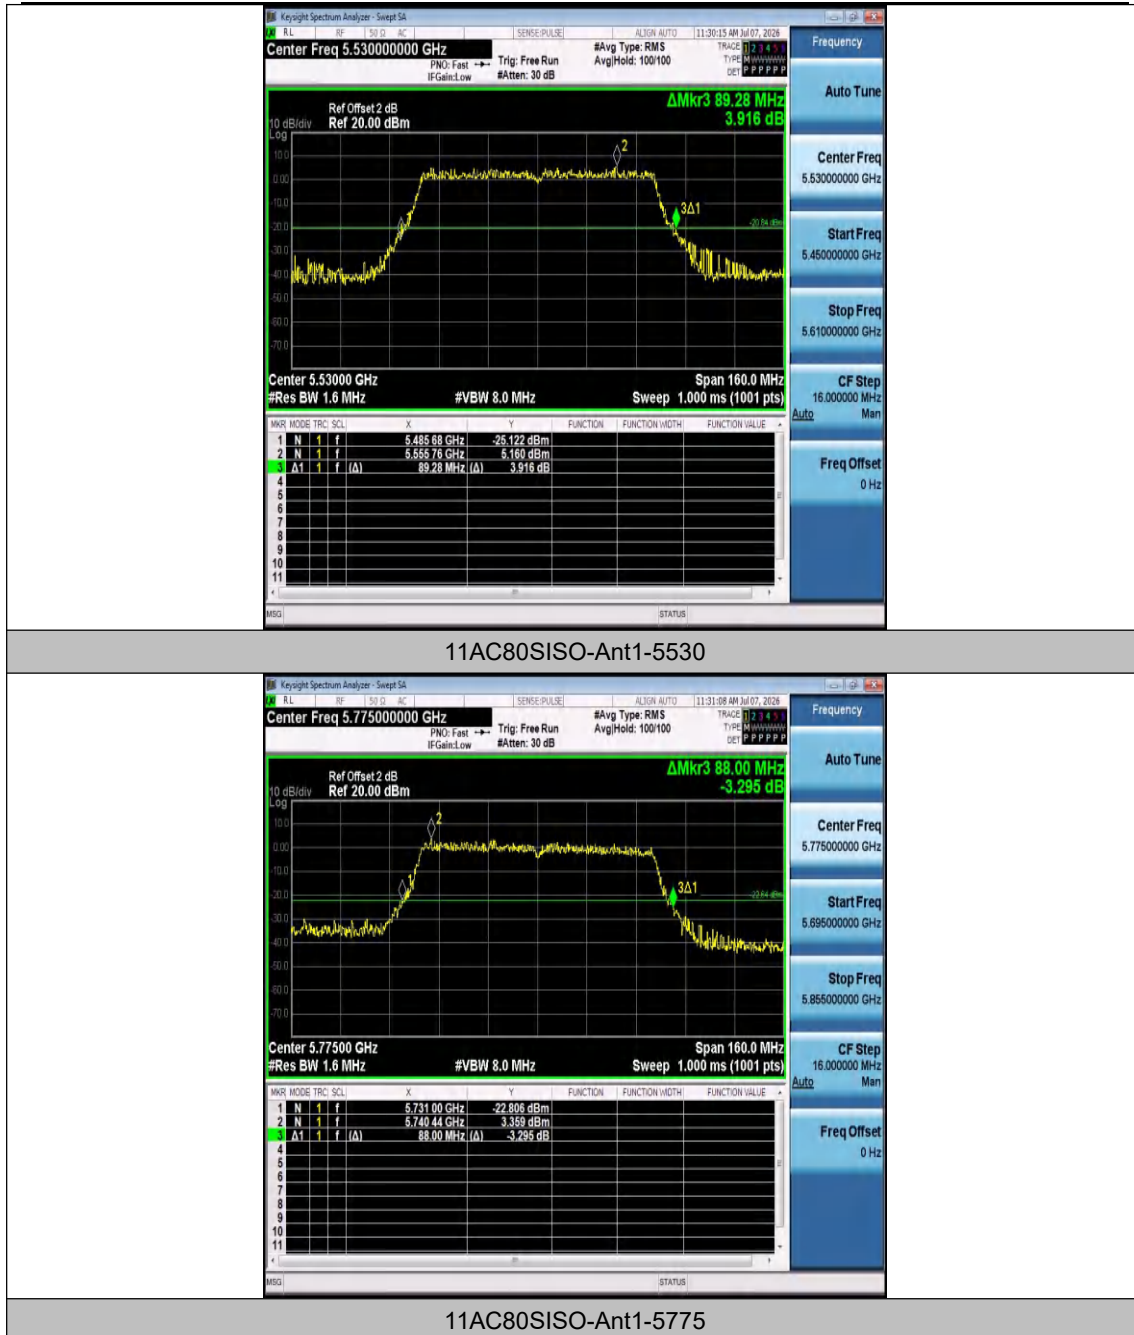


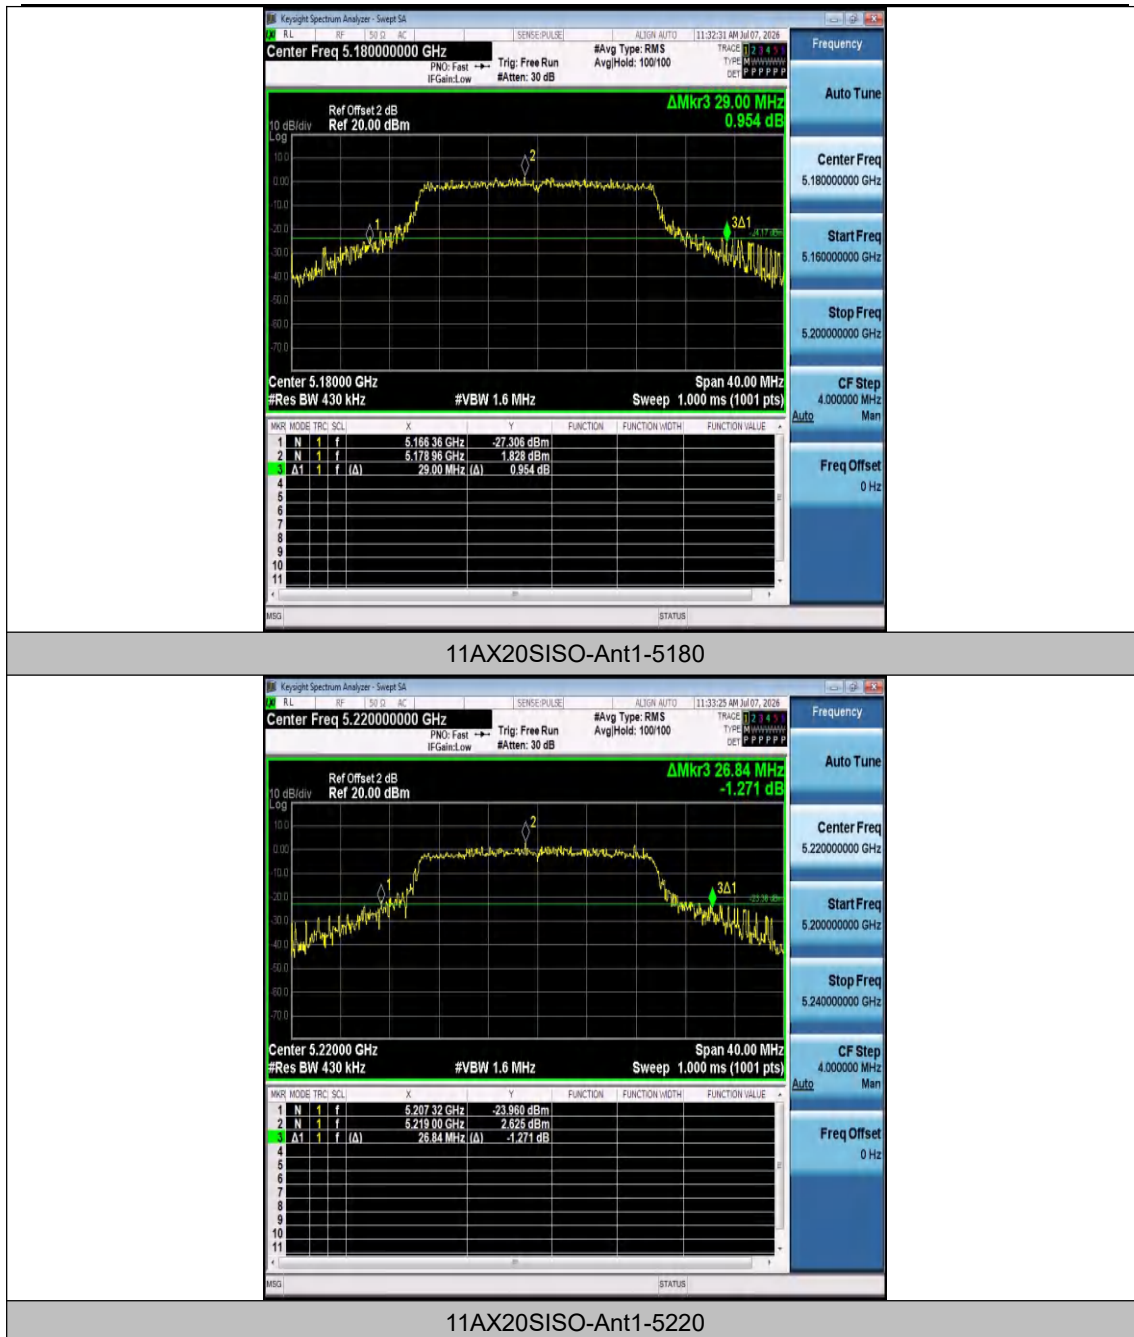


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

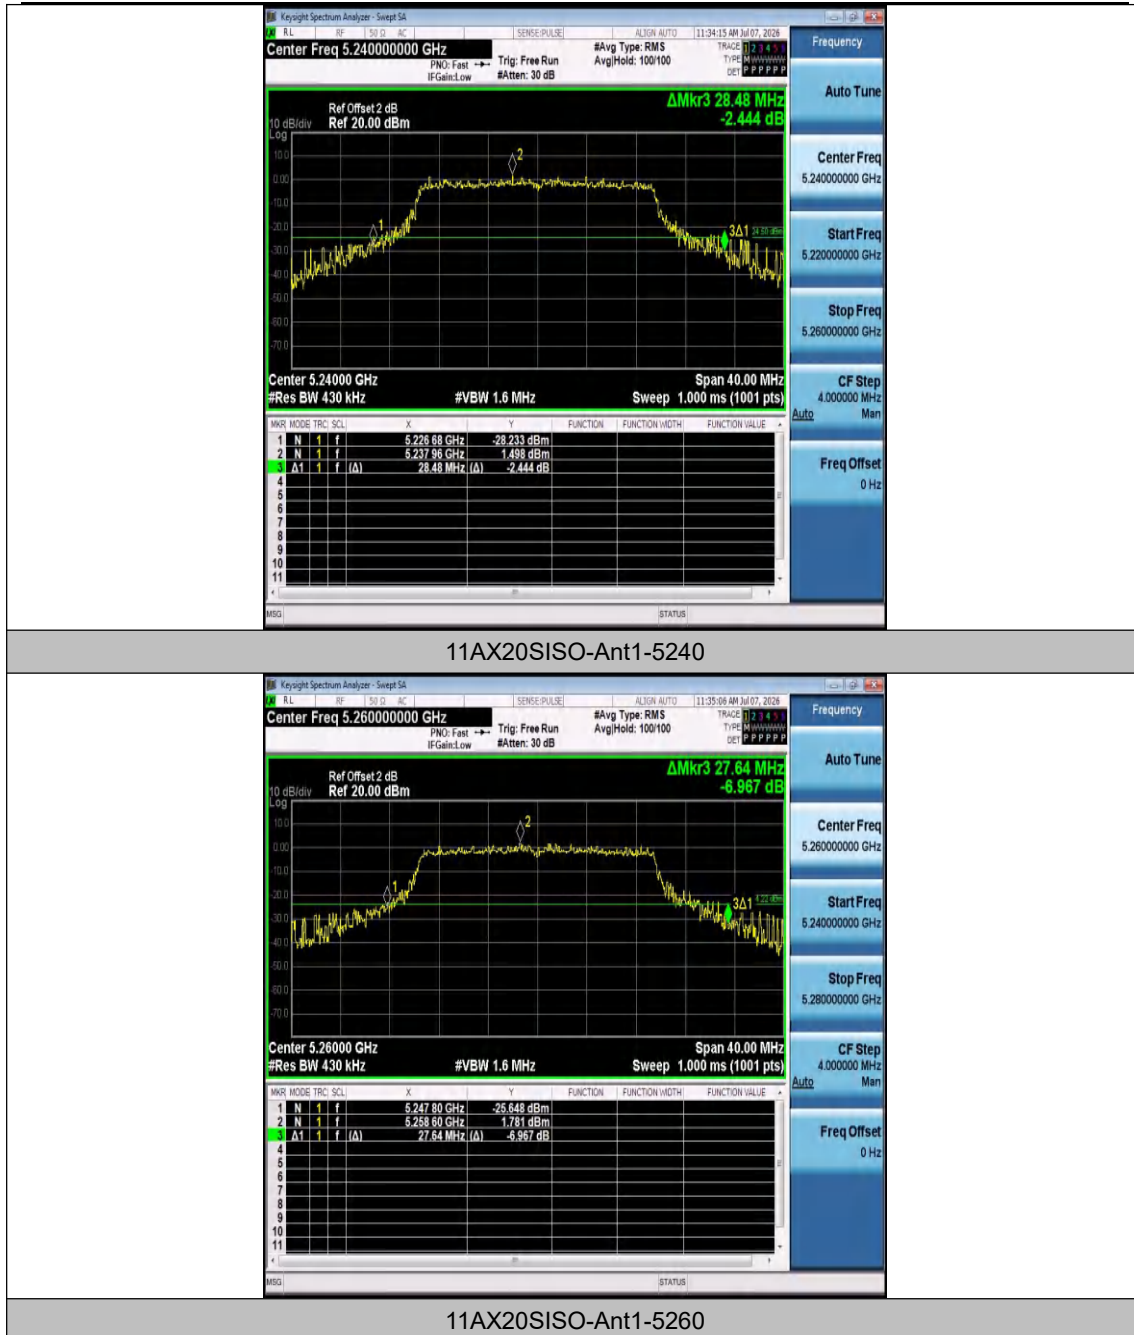


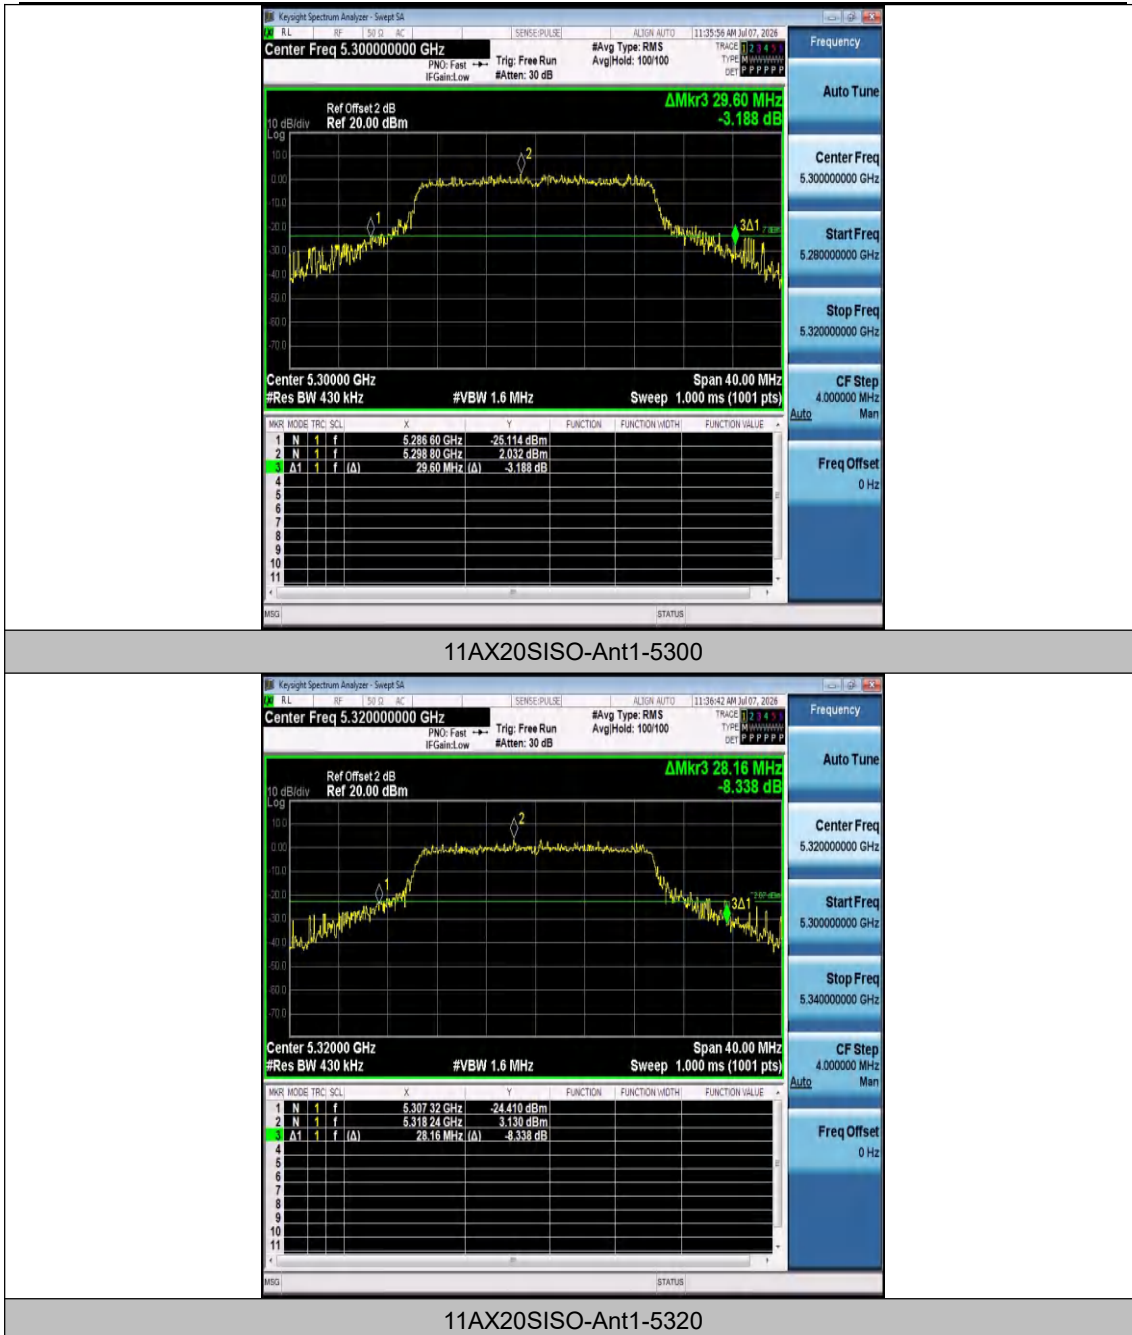



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

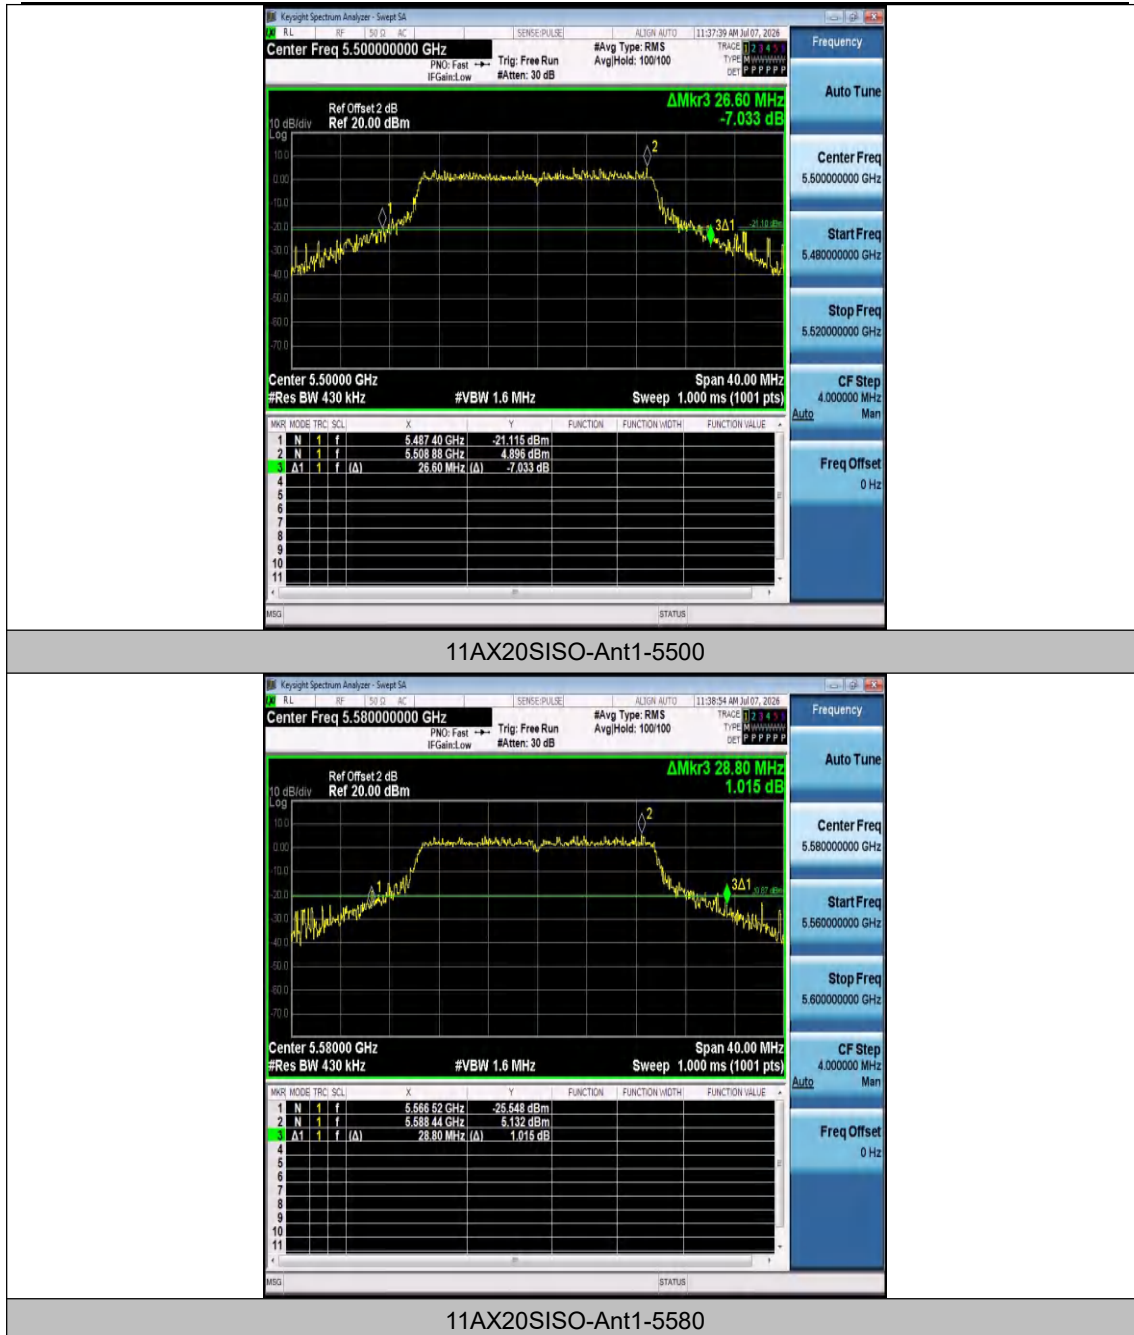


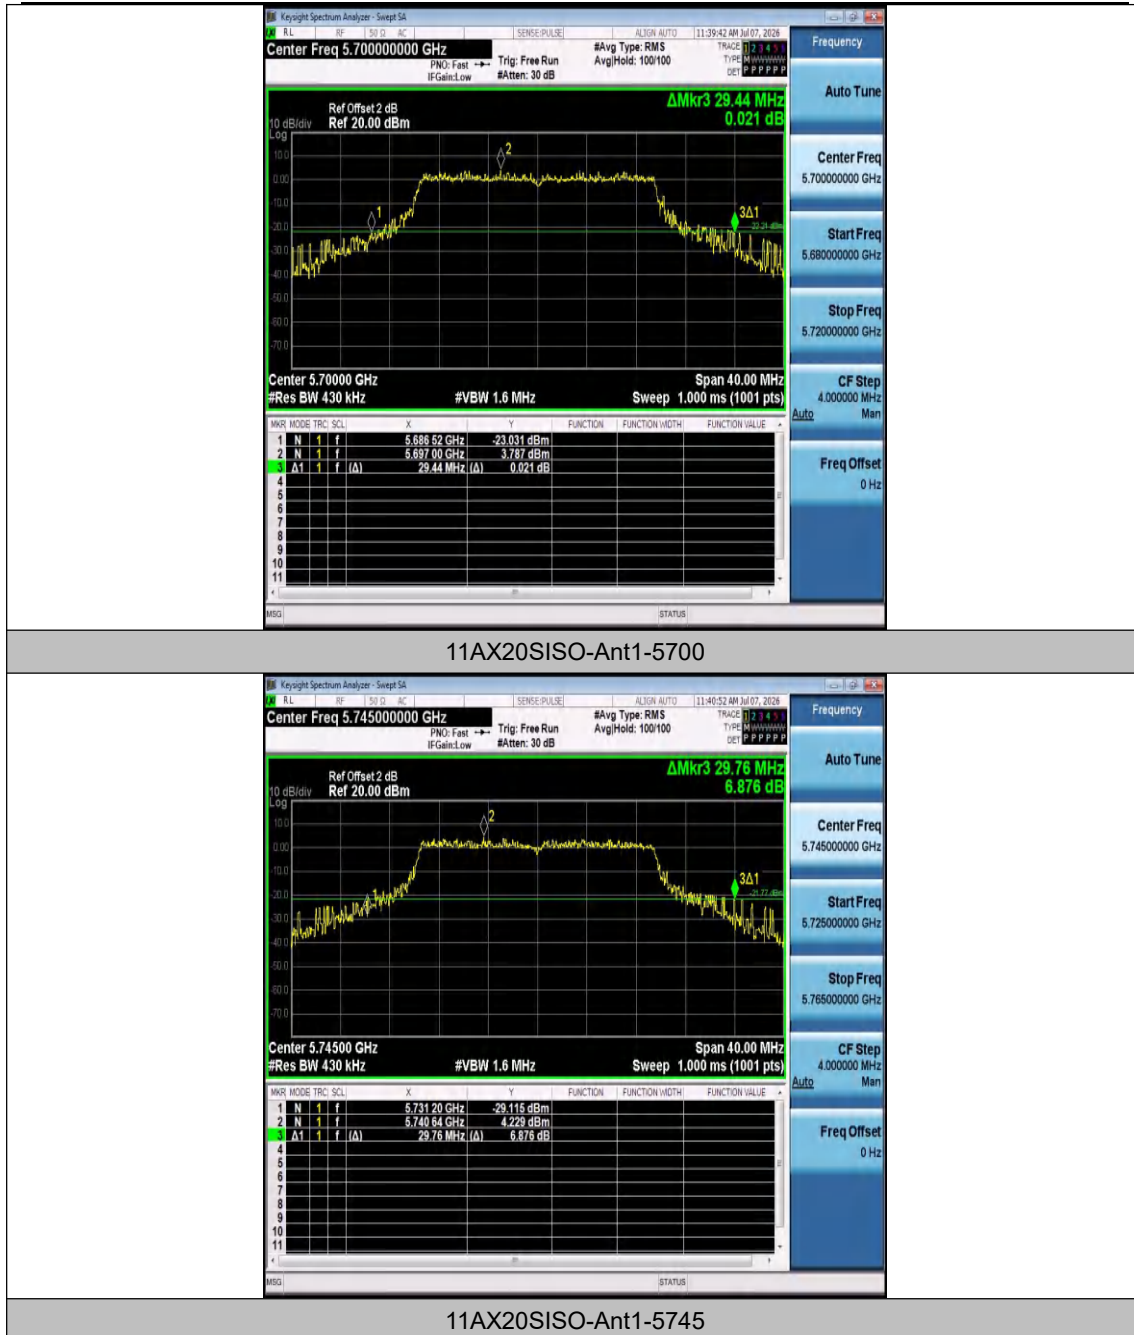

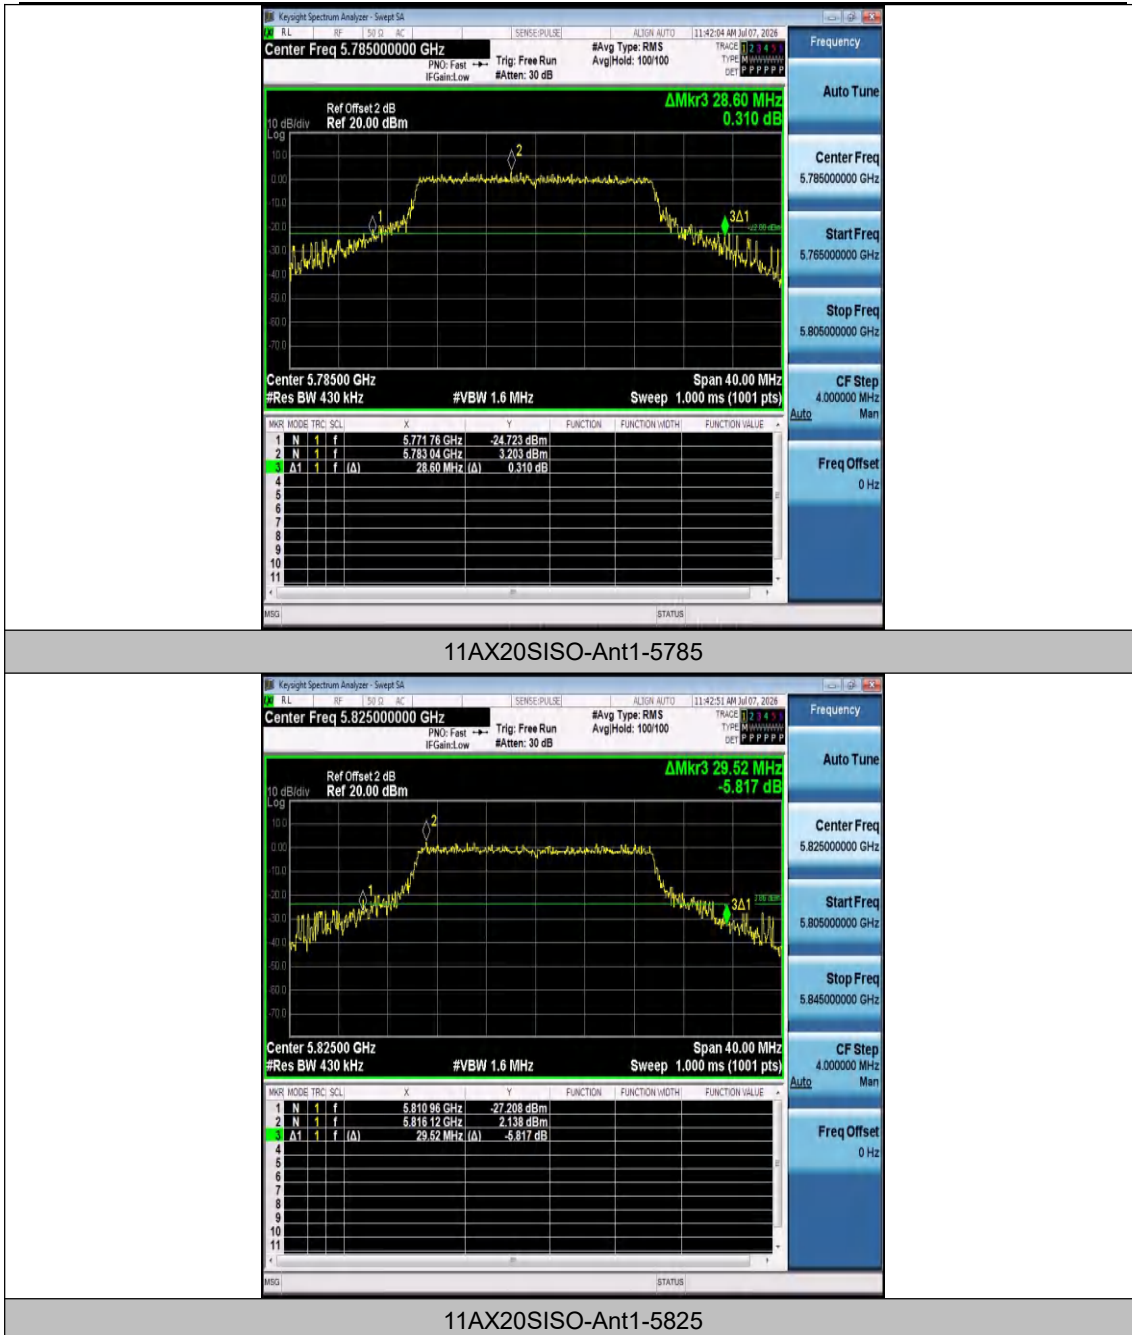

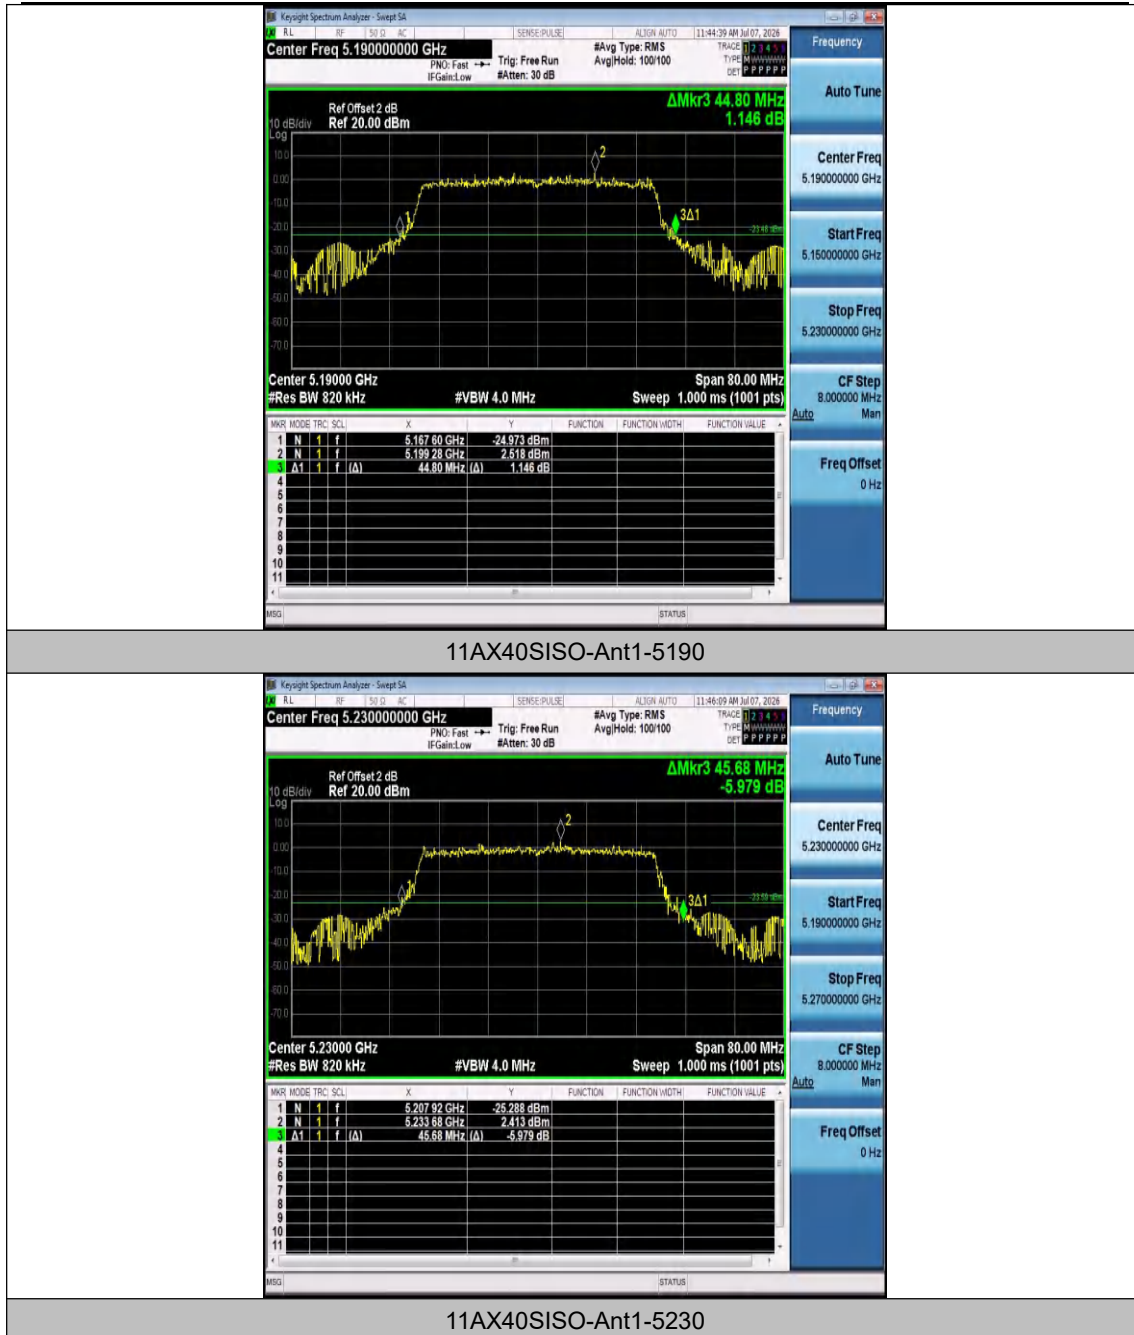

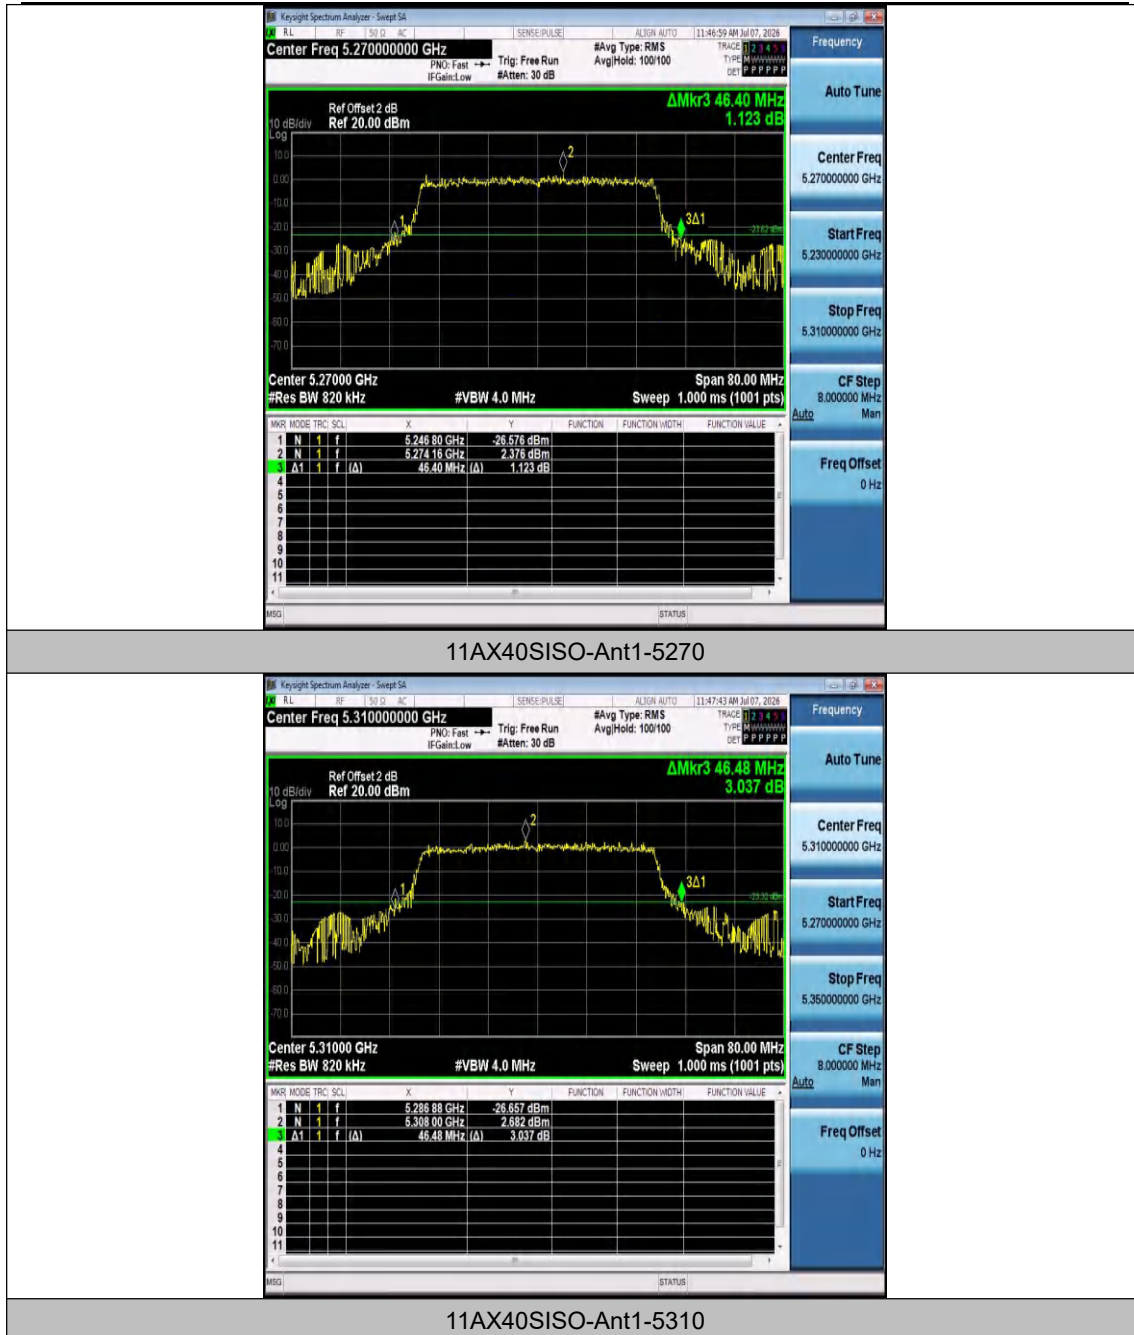


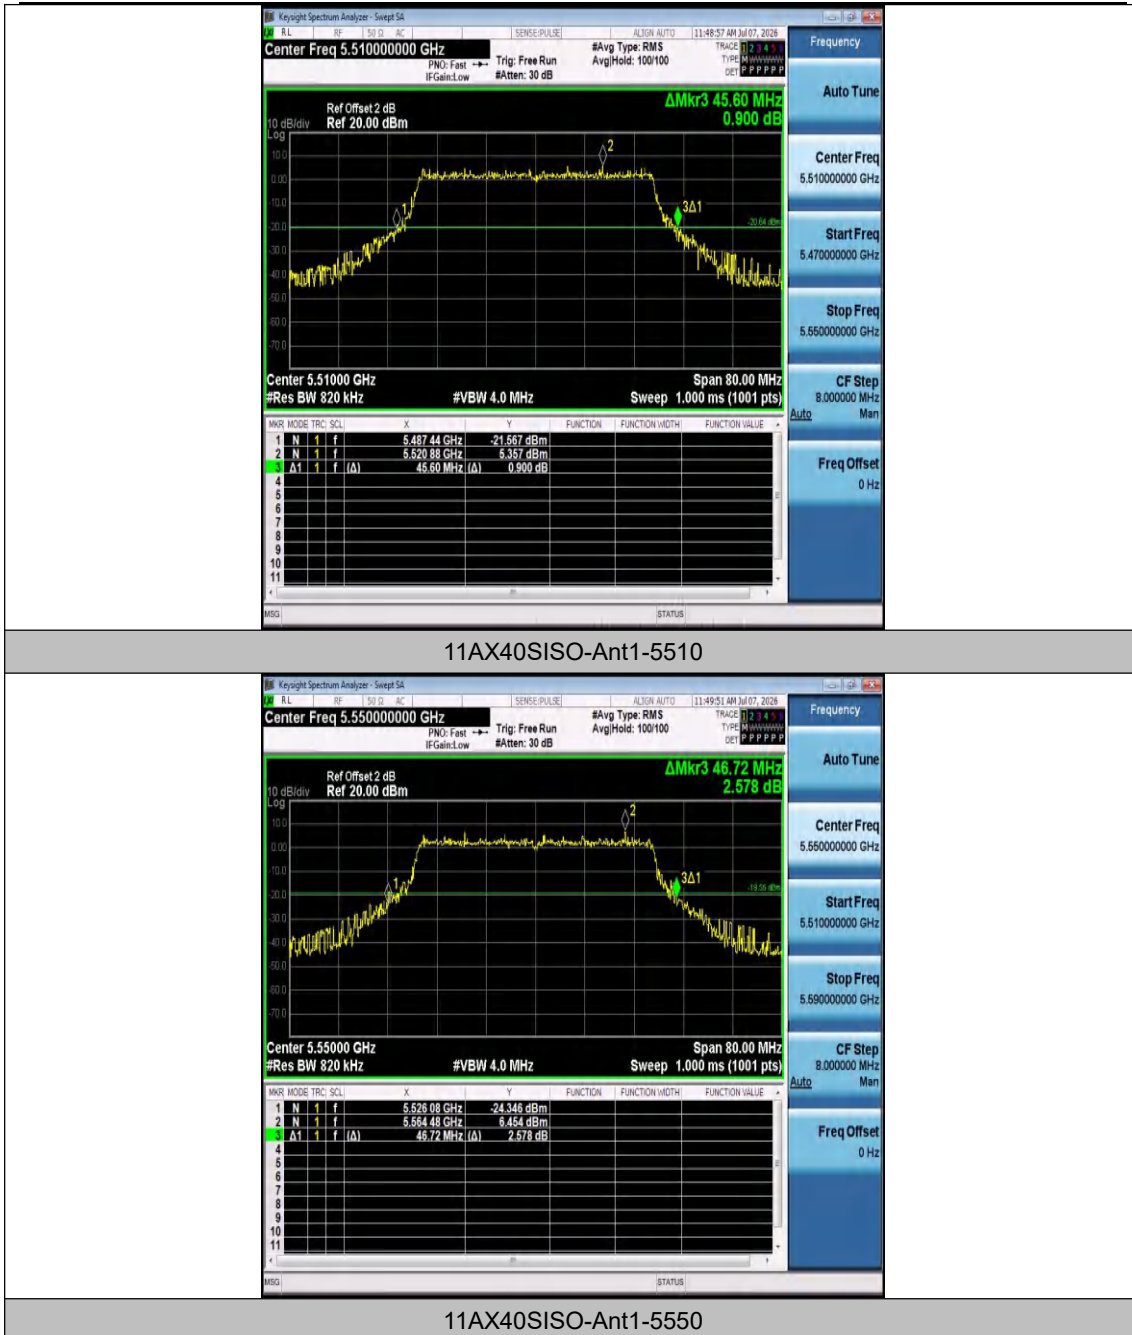


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

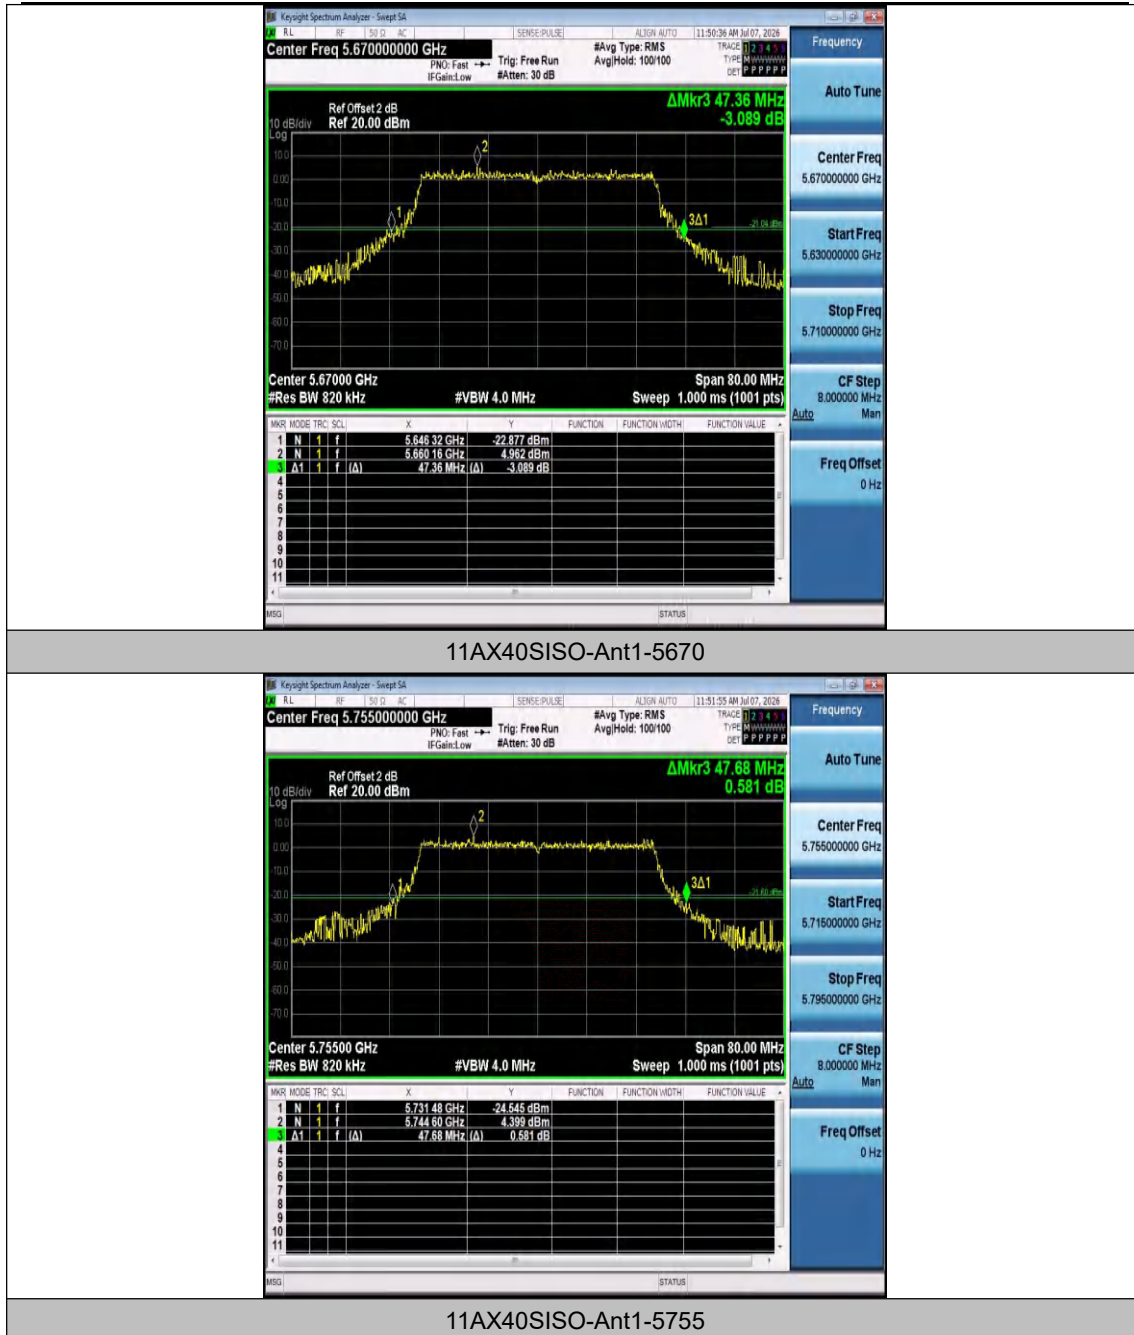


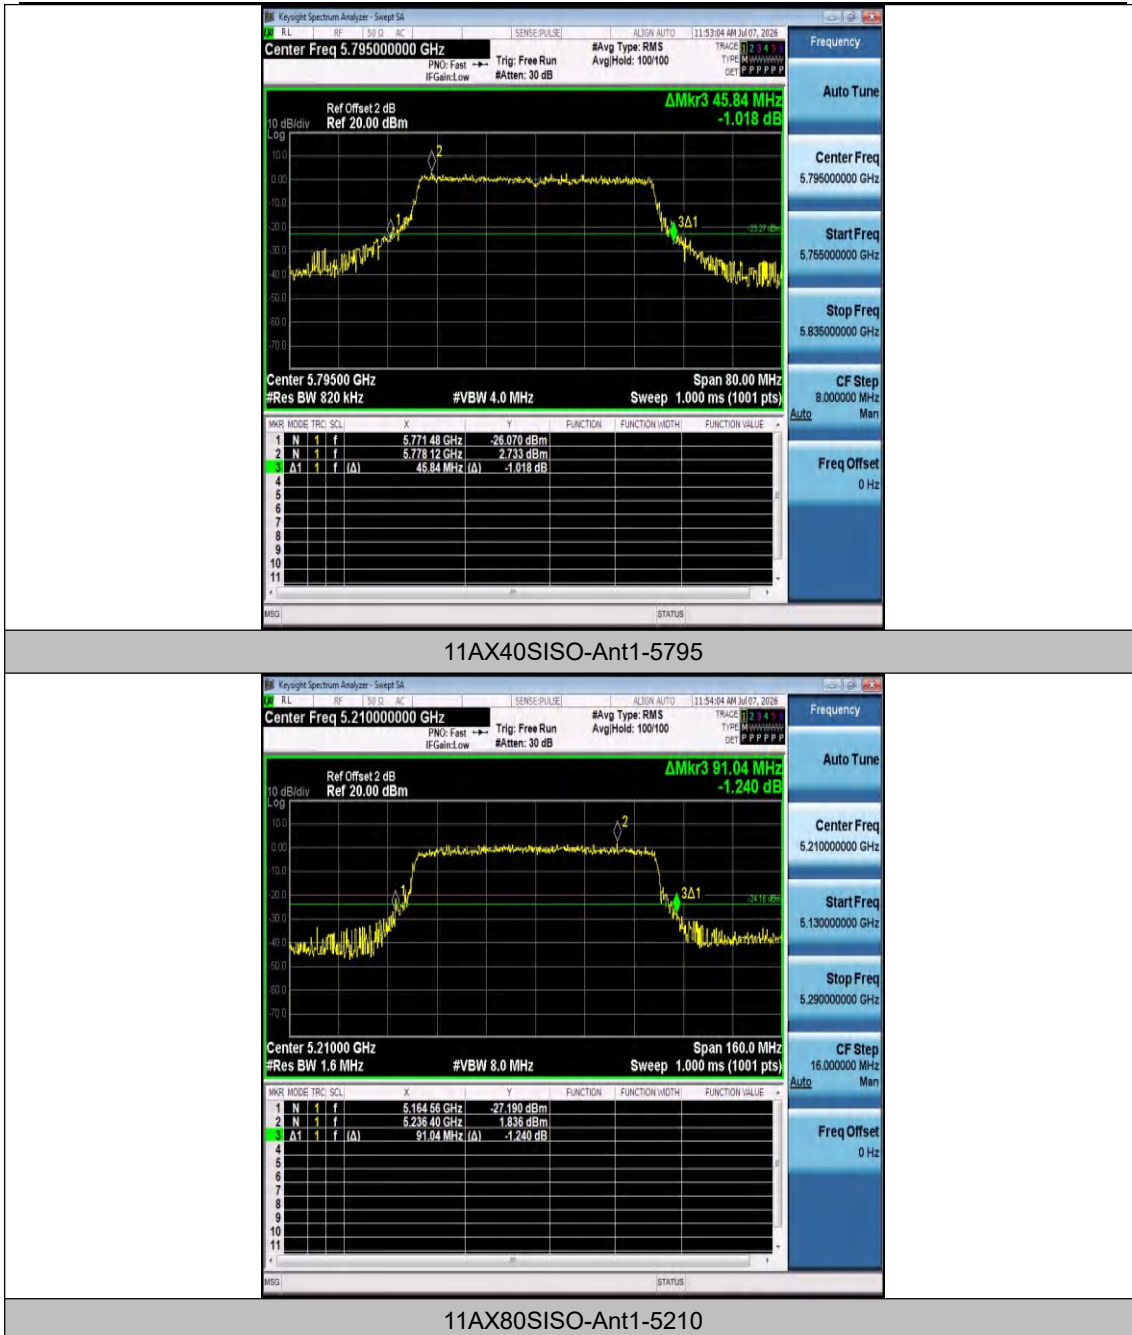


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

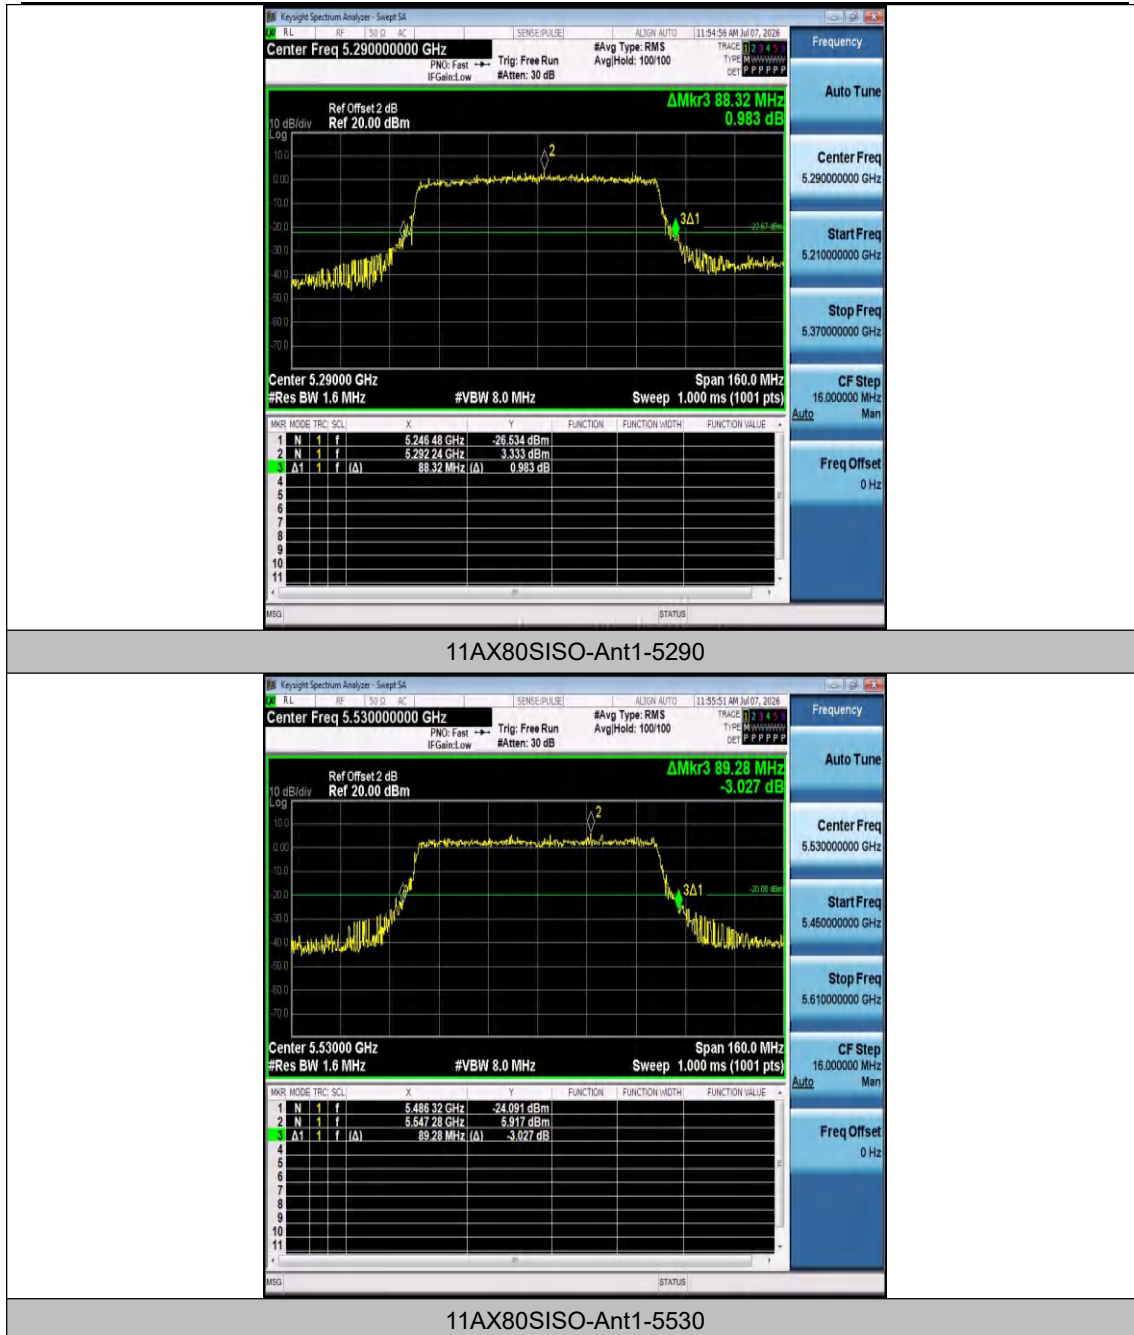

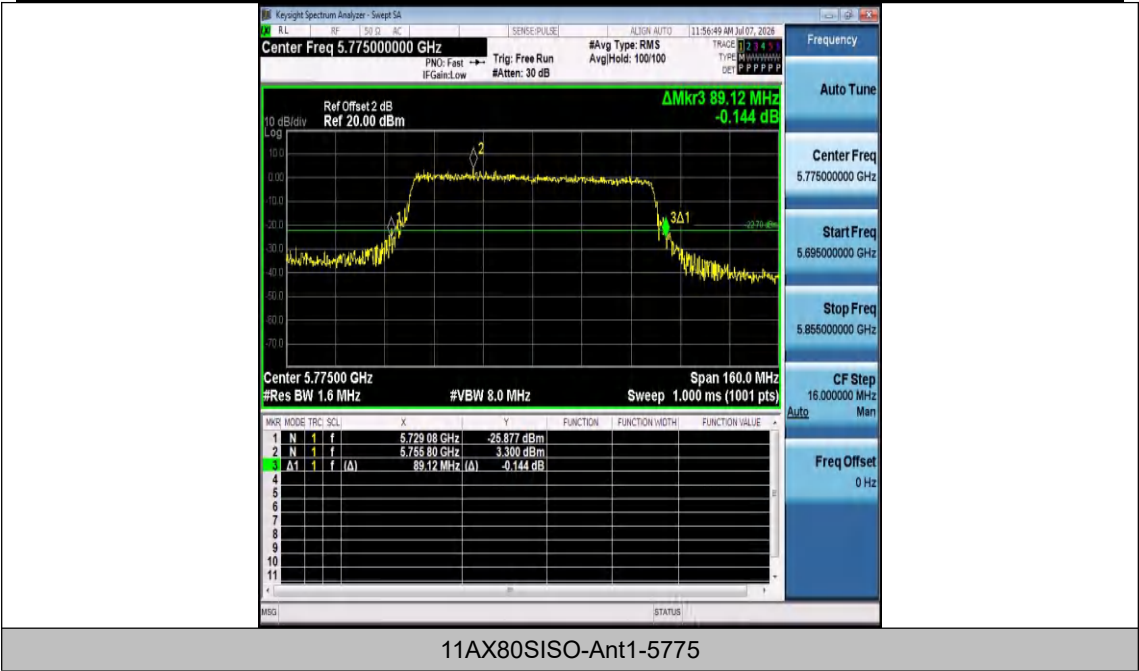

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	17.454	5171.2306	5188.6846	---	---
11A	Ant1	5220	17.389	5211.2240	5228.6130	---	---
11A	Ant1	5240	17.516	5231.1537	5248.6697	---	---
11A	Ant1	5260	17.526	5251.1743	5268.7003	---	---
11A	Ant1	5300	17.403	5291.2860	5308.6890	---	---
11A	Ant1	5320	17.444	5311.2779	5328.7219	---	---
11A	Ant1	5500	17.605	5491.2057	5508.8107	---	---
11A	Ant1	5580	17.690	5571.0967	5588.7867	---	---
11A	Ant1	5700	17.624	5691.0749	5708.6989	---	---
11A	Ant1	5745	17.509	5736.1897	5753.6987	---	---
11A	Ant1	5785	17.701	5775.9919	5793.6929	---	---
11A	Ant1	5825	17.651	5816.0611	5833.7121	---	---
11N20SISO	Ant1	5180	18.524	5170.6920	5189.2160	---	---
11N20SISO	Ant1	5220	18.550	5210.7704	5229.3204	---	---
11N20SISO	Ant1	5240	18.485	5230.7486	5249.2336	---	---
11N20SISO	Ant1	5260	18.593	5250.6914	5269.2844	---	---
11N20SISO	Ant1	5300	18.499	5290.7543	5309.2533	---	---
11N20SISO	Ant1	5320	18.566	5310.7735	5329.3395	---	---
11N20SISO	Ant1	5500	18.713	5490.6701	5509.3831	---	---
11N20SISO	Ant1	5580	18.702	5570.6418	5589.3438	---	---
11N20SISO	Ant1	5700	18.767	5690.5856	5709.3526	---	---
11N20SISO	Ant1	5745	18.694	5735.6498	5754.3438	---	---
11N20SISO	Ant1	5785	18.713	5775.5724	5794.2854	---	---
11N20SISO	Ant1	5825	18.752	5815.5248	5834.2768	---	---
11N40SISO	Ant1	5190	36.859	5171.6380	5208.4970	---	---
11N40SISO	Ant1	5230	36.877	5211.6151	5248.4921	---	---
11N40SISO	Ant1	5270	36.771	5251.7112	5288.4822	---	---
11N40SISO	Ant1	5310	36.805	5291.7896	5328.5946	---	---
11N40SISO	Ant1	5510	37.267	5491.4361	5528.7031	---	---
11N40SISO	Ant1	5550	37.087	5531.5617	5568.6487	---	---
11N40SISO	Ant1	5670	37.227	5651.3835	5688.6105	---	---
11N40SISO	Ant1	5755	37.000	5736.4431	5773.4431	---	---
11N40SISO	Ant1	5795	37.205	5776.2685	5813.4735	---	---
11AC20SISO	Ant1	5180	18.525	5170.7552	5189.2802	---	---
11AC20SISO	Ant1	5220	18.532	5210.6924	5229.2244	---	---
11AC20SISO	Ant1	5240	18.520	5230.7430	5249.2630	---	---
11AC20SISO	Ant1	5260	18.551	5250.7356	5269.2866	---	---

11AC20SISO	Ant1	5300	18.578	5290.7540	5309.3320	---	---
11AC20SISO	Ant1	5320	18.529	5310.7639	5329.2929	---	---
11AC20SISO	Ant1	5500	18.645	5490.7088	5509.3538	---	---
11AC20SISO	Ant1	5580	18.755	5570.5445	5589.2995	---	---
11AC20SISO	Ant1	5700	18.716	5690.6003	5709.3163	---	---
11AC20SISO	Ant1	5745	18.712	5735.6317	5754.3437	---	---
11AC20SISO	Ant1	5785	18.757	5775.5506	5794.3076	---	---
11AC20SISO	Ant1	5825	18.845	5815.4337	5834.2787	---	---
11AC40SISO	Ant1	5190	36.953	5171.5380	5208.4910	---	---
11AC40SISO	Ant1	5230	36.889	5211.5249	5248.4139	---	---
11AC40SISO	Ant1	5270	36.857	5251.6867	5288.5437	---	---
11AC40SISO	Ant1	5310	36.817	5291.7211	5328.5381	---	---
11AC40SISO	Ant1	5510	37.197	5491.4015	5528.5985	---	---
11AC40SISO	Ant1	5550	37.247	5531.3330	5568.5800	---	---
11AC40SISO	Ant1	5670	37.086	5651.5613	5688.6473	---	---
11AC40SISO	Ant1	5755	37.058	5736.4596	5773.5176	---	---
11AC40SISO	Ant1	5795	37.222	5776.2732	5813.4952	---	---
11AC80SISO	Ant1	5210	76.299	5172.0579	5248.3569	---	---
11AC80SISO	Ant1	5290	76.367	5252.0077	5328.3747	---	---
11AC80SISO	Ant1	5530	76.322	5492.0091	5568.3311	---	---
11AC80SISO	Ant1	5775	76.527	5736.5423	5813.0693	---	---
11AX20SISO	Ant1	5180	19.376	5170.2886	5189.6646	---	---
11AX20SISO	Ant1	5220	19.343	5210.2988	5229.6418	---	---
11AX20SISO	Ant1	5240	19.303	5230.3151	5249.6181	---	---
11AX20SISO	Ant1	5260	19.253	5250.3708	5269.6238	---	---
11AX20SISO	Ant1	5300	19.387	5290.3756	5309.7626	---	---
11AX20SISO	Ant1	5320	19.250	5310.4010	5329.6510	---	---
11AX20SISO	Ant1	5500	19.471	5490.3130	5509.7840	---	---
11AX20SISO	Ant1	5580	19.549	5570.2263	5589.7753	---	---
11AX20SISO	Ant1	5700	19.373	5690.3165	5709.6895	---	---
11AX20SISO	Ant1	5745	19.540	5735.2008	5754.7408	---	---
11AX20SISO	Ant1	5785	19.498	5775.1968	5794.6948	---	---
11AX20SISO	Ant1	5825	19.437	5815.2167	5834.6537	---	---
11AX40SISO	Ant1	5190	38.170	5170.9558	5209.1258	---	---
11AX40SISO	Ant1	5230	38.056	5211.0070	5249.0630	---	---
11AX40SISO	Ant1	5270	38.256	5250.9749	5289.2309	---	---
11AX40SISO	Ant1	5310	38.130	5291.0006	5329.1306	---	---
11AX40SISO	Ant1	5510	38.289	5490.8925	5529.1815	---	---
11AX40SISO	Ant1	5550	38.337	5530.8706	5569.2076	---	---
11AX40SISO	Ant1	5670	38.344	5650.8913	5689.2353	---	---
11AX40SISO	Ant1	5755	38.415	5735.8666	5774.2816	---	---
11AX40SISO	Ant1	5795	38.356	5775.7007	5814.0567	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX80SISO	Ant1	5210	77.421	5171.4179	5248.8389	---	---
11AX80SISO	Ant1	5290	77.426	5251.5607	5328.9867	---	---
11AX80SISO	Ant1	5530	77.912	5491.2453	5569.1573	---	---
11AX80SISO	Ant1	5775	77.946	5735.9567	5813.9027	---	---

Test Graphs



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

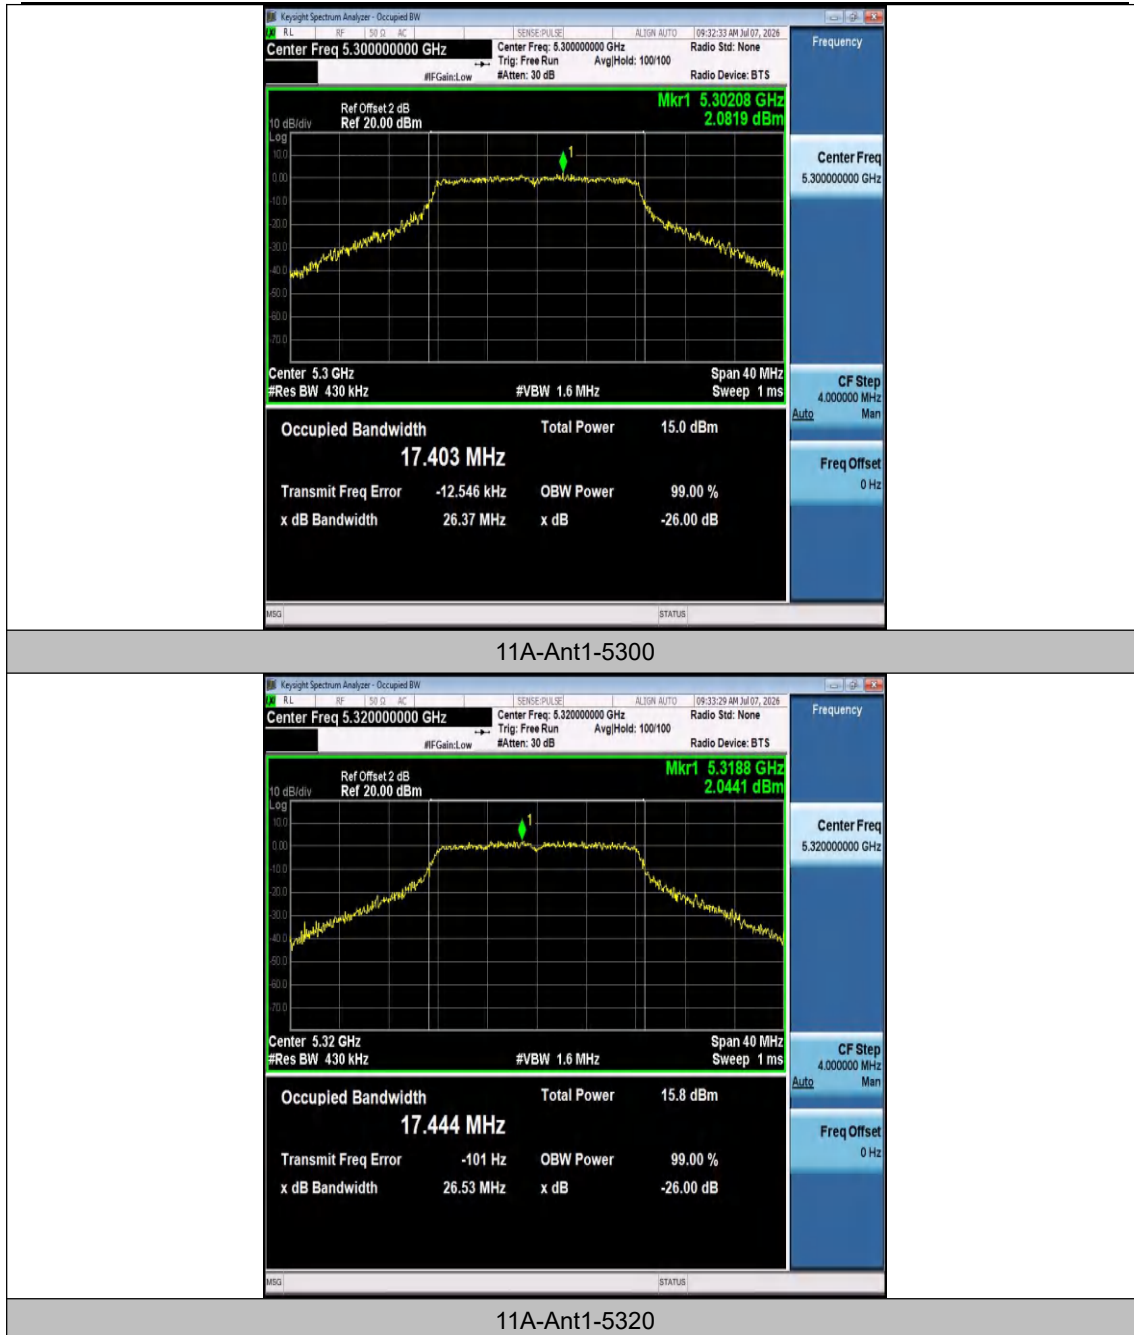

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



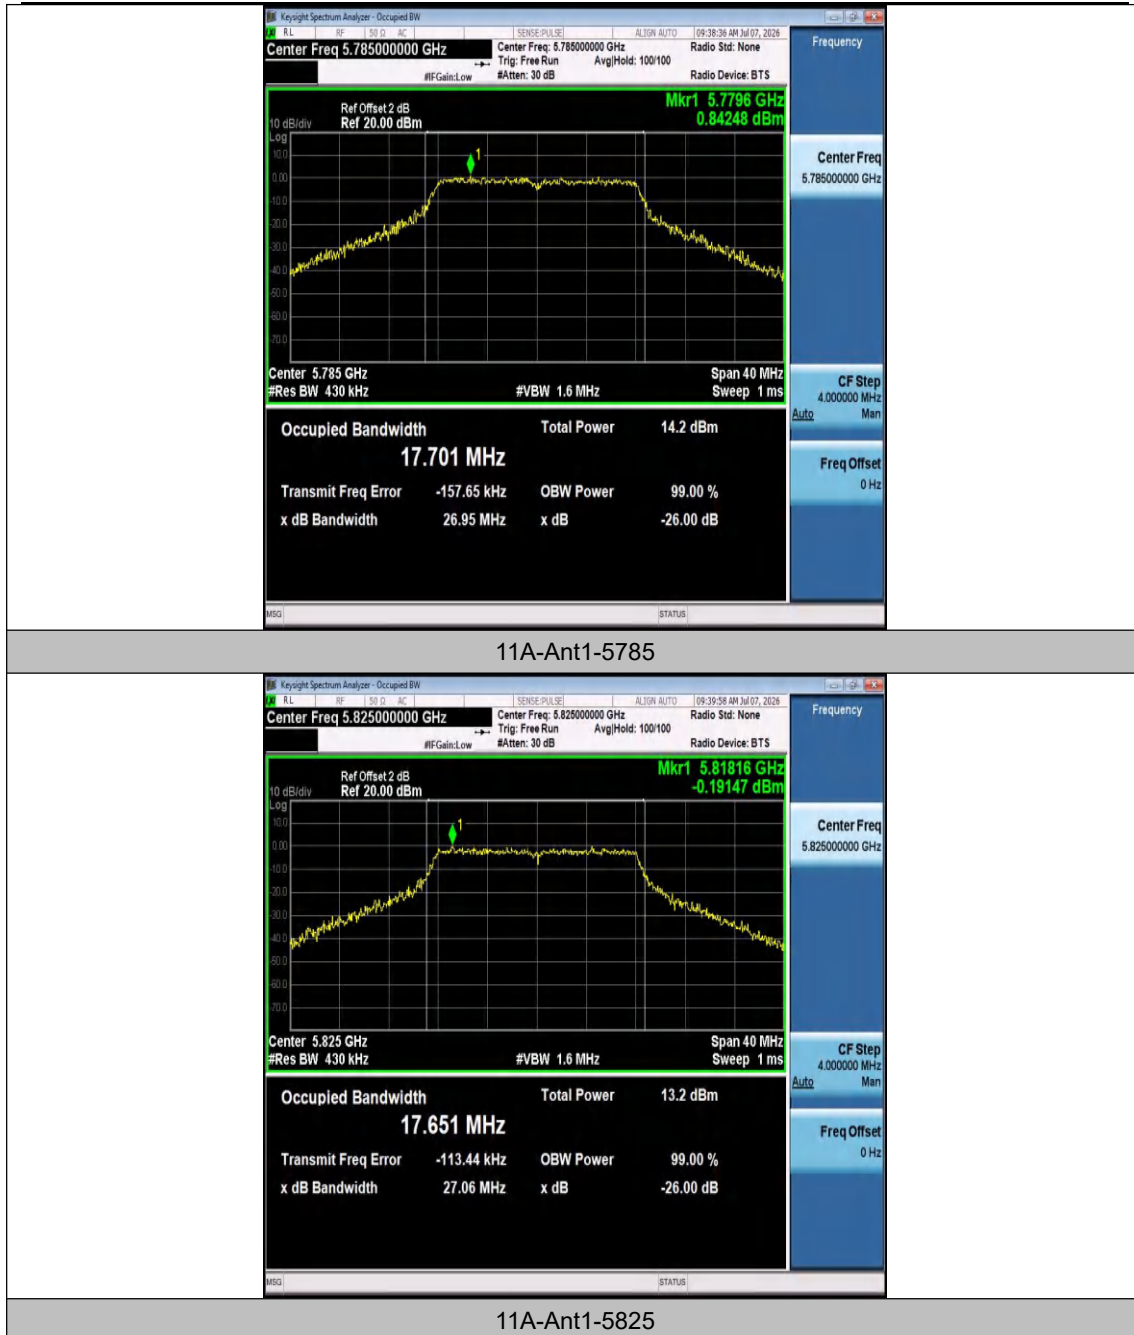




Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

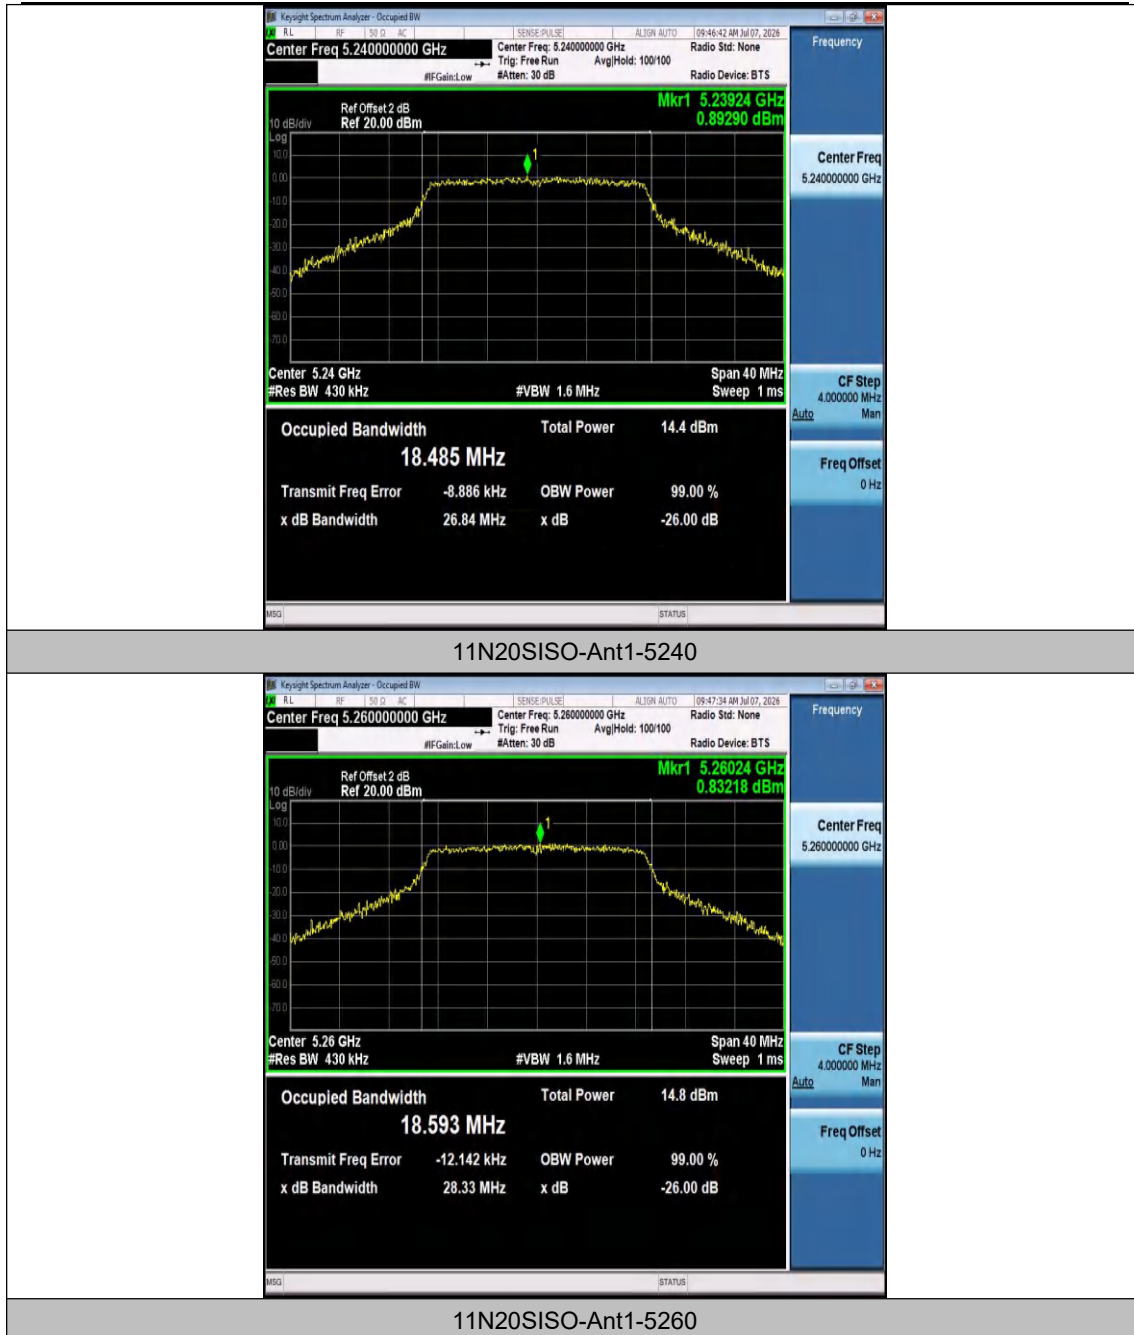

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

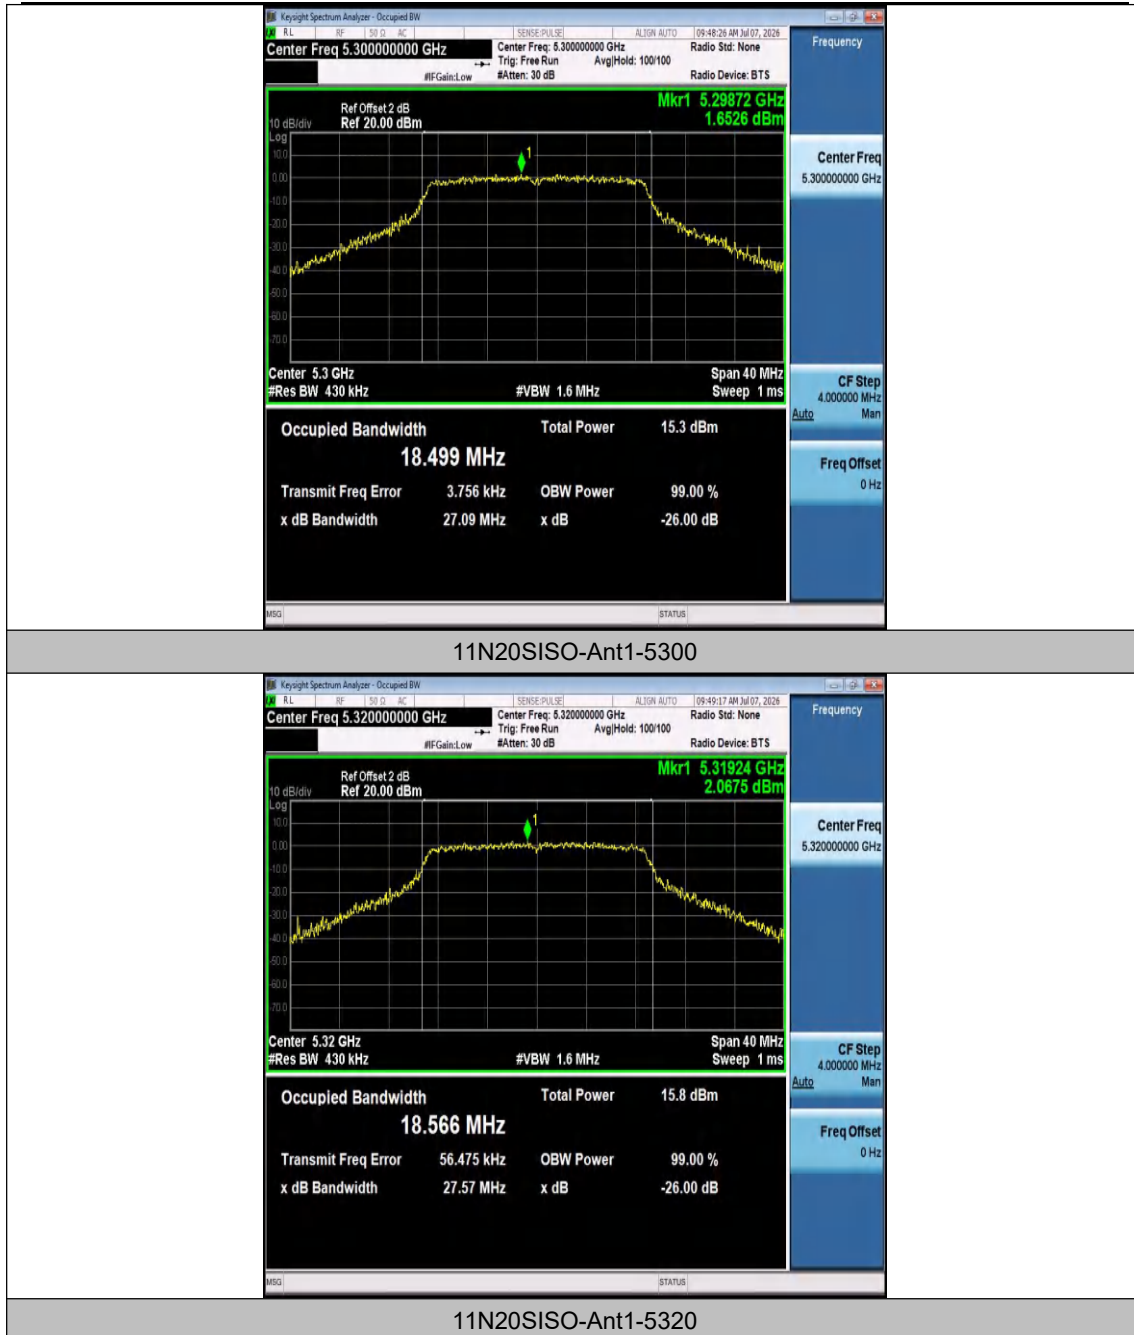

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

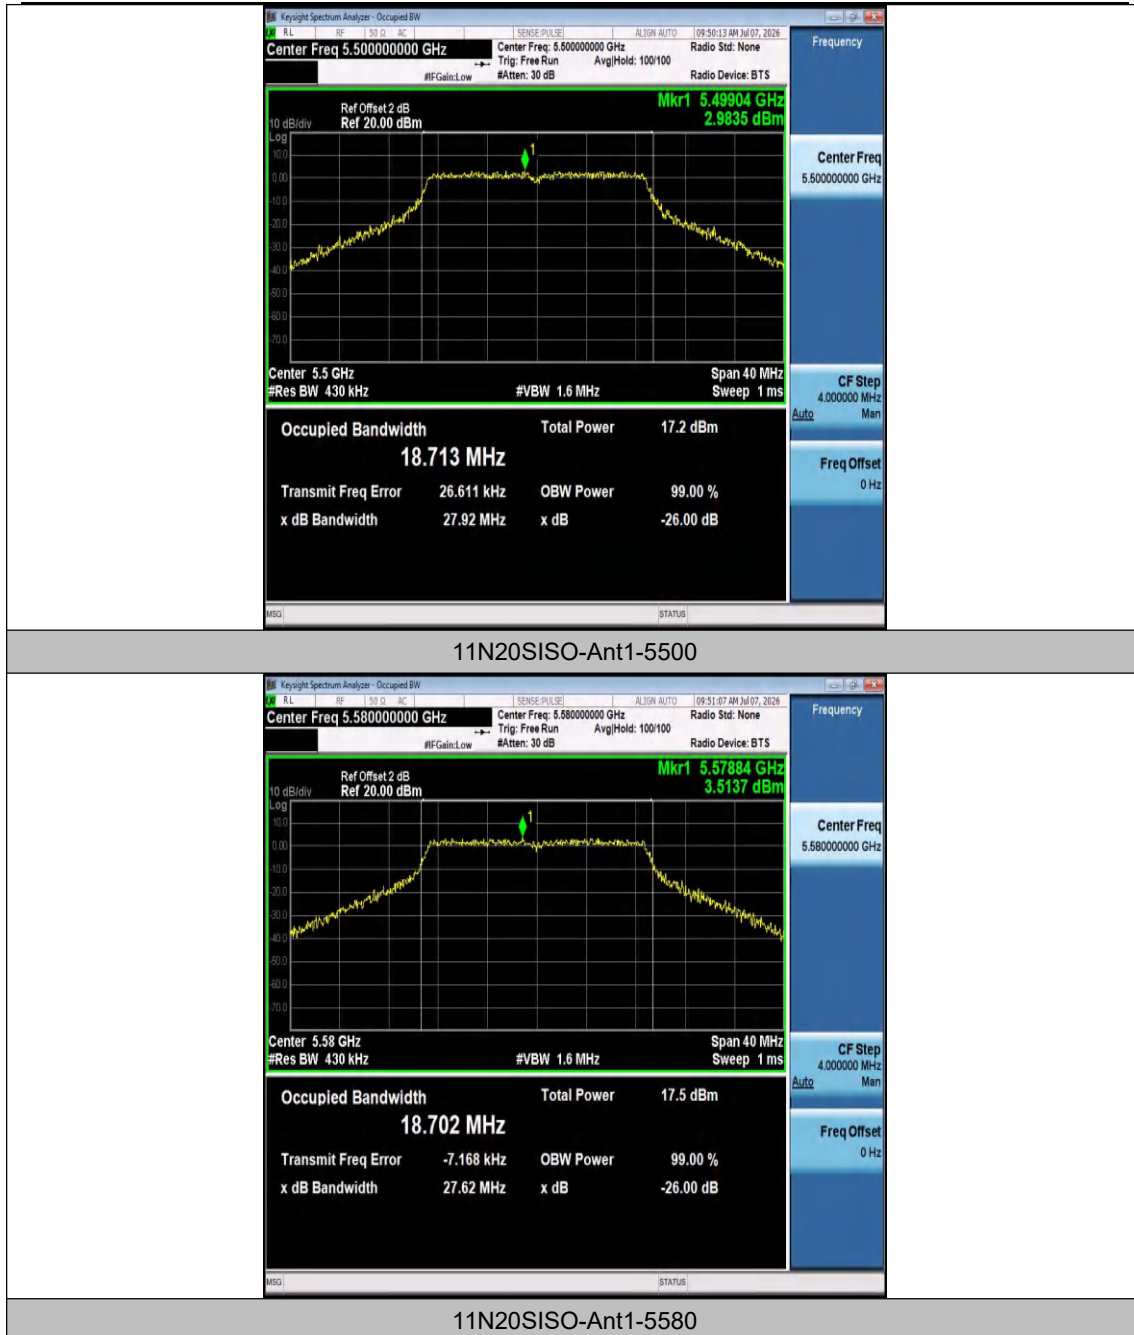

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

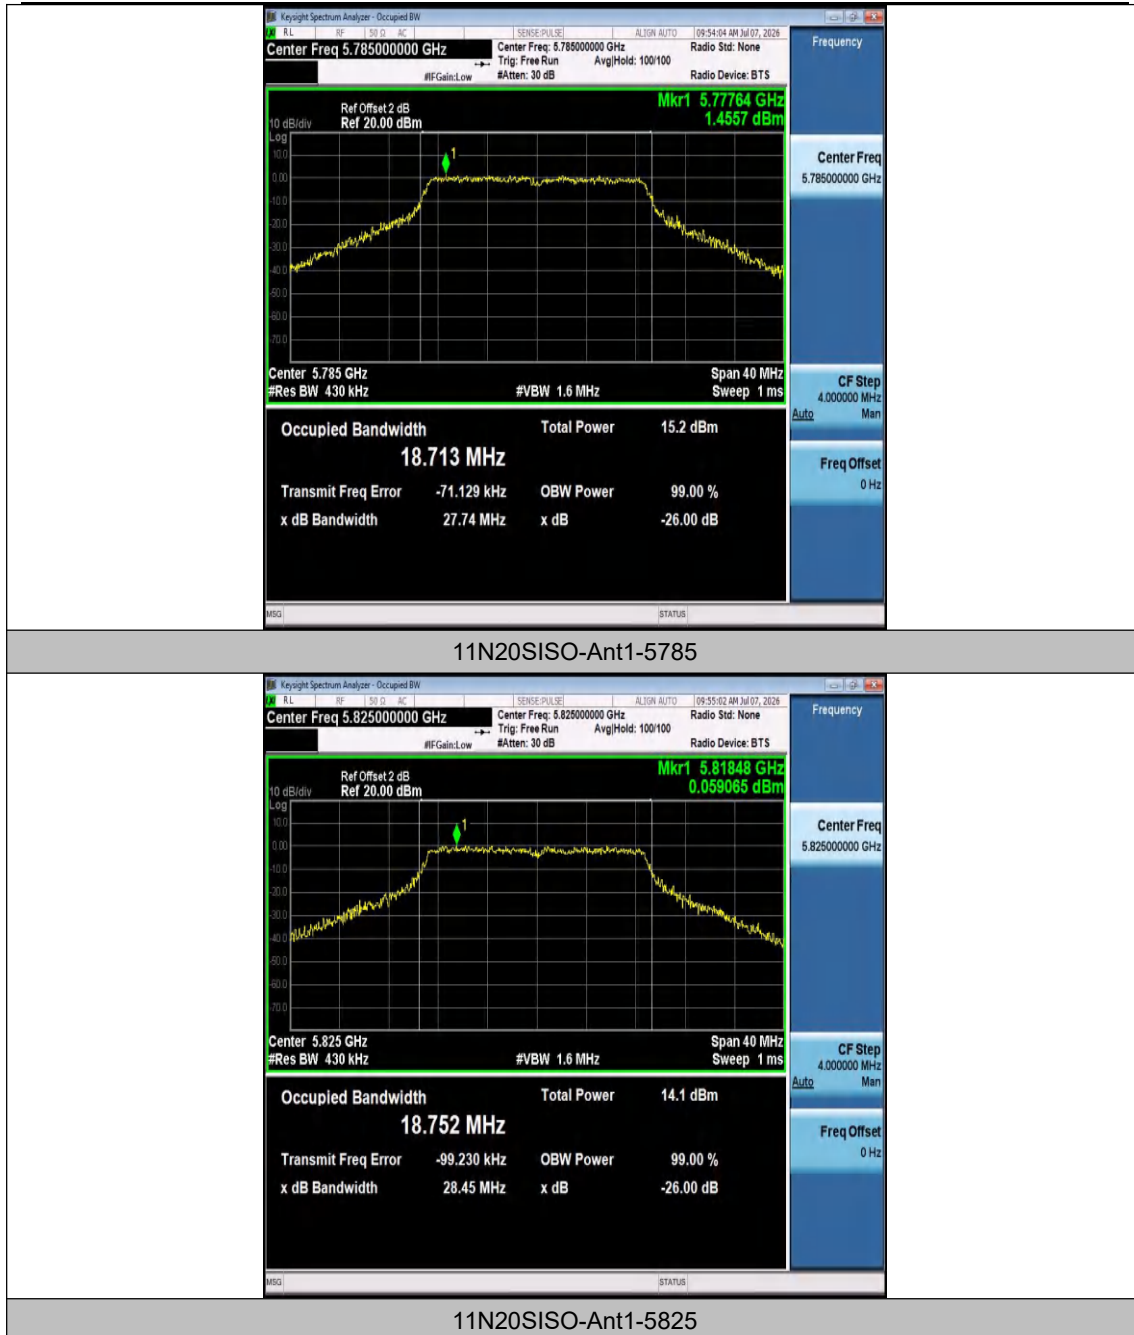

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

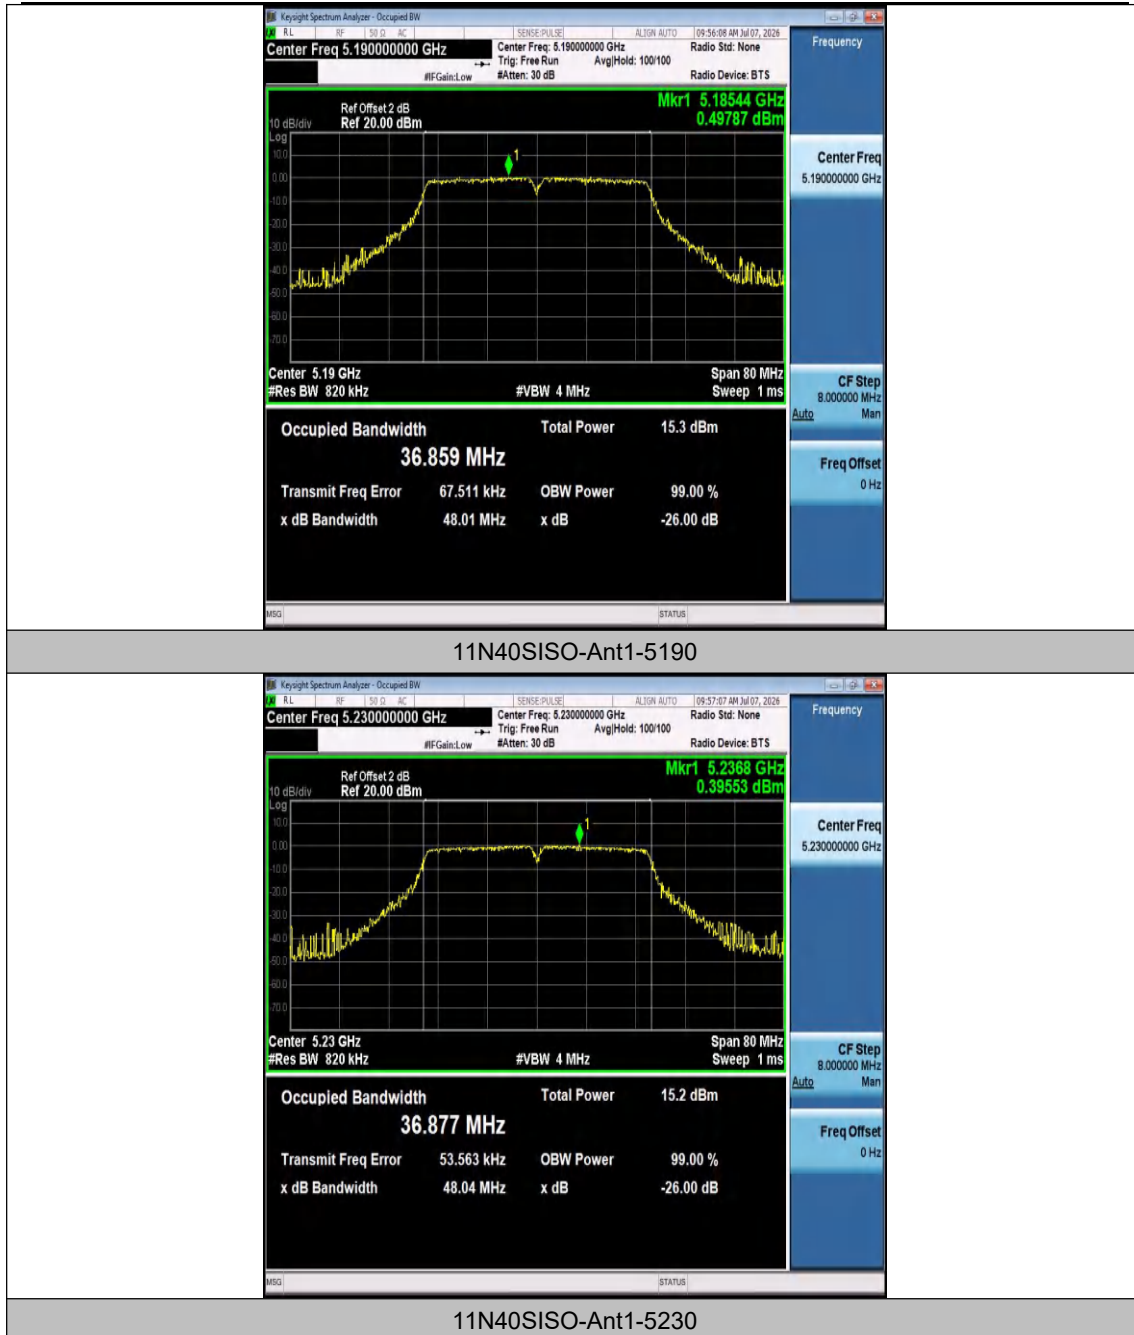

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

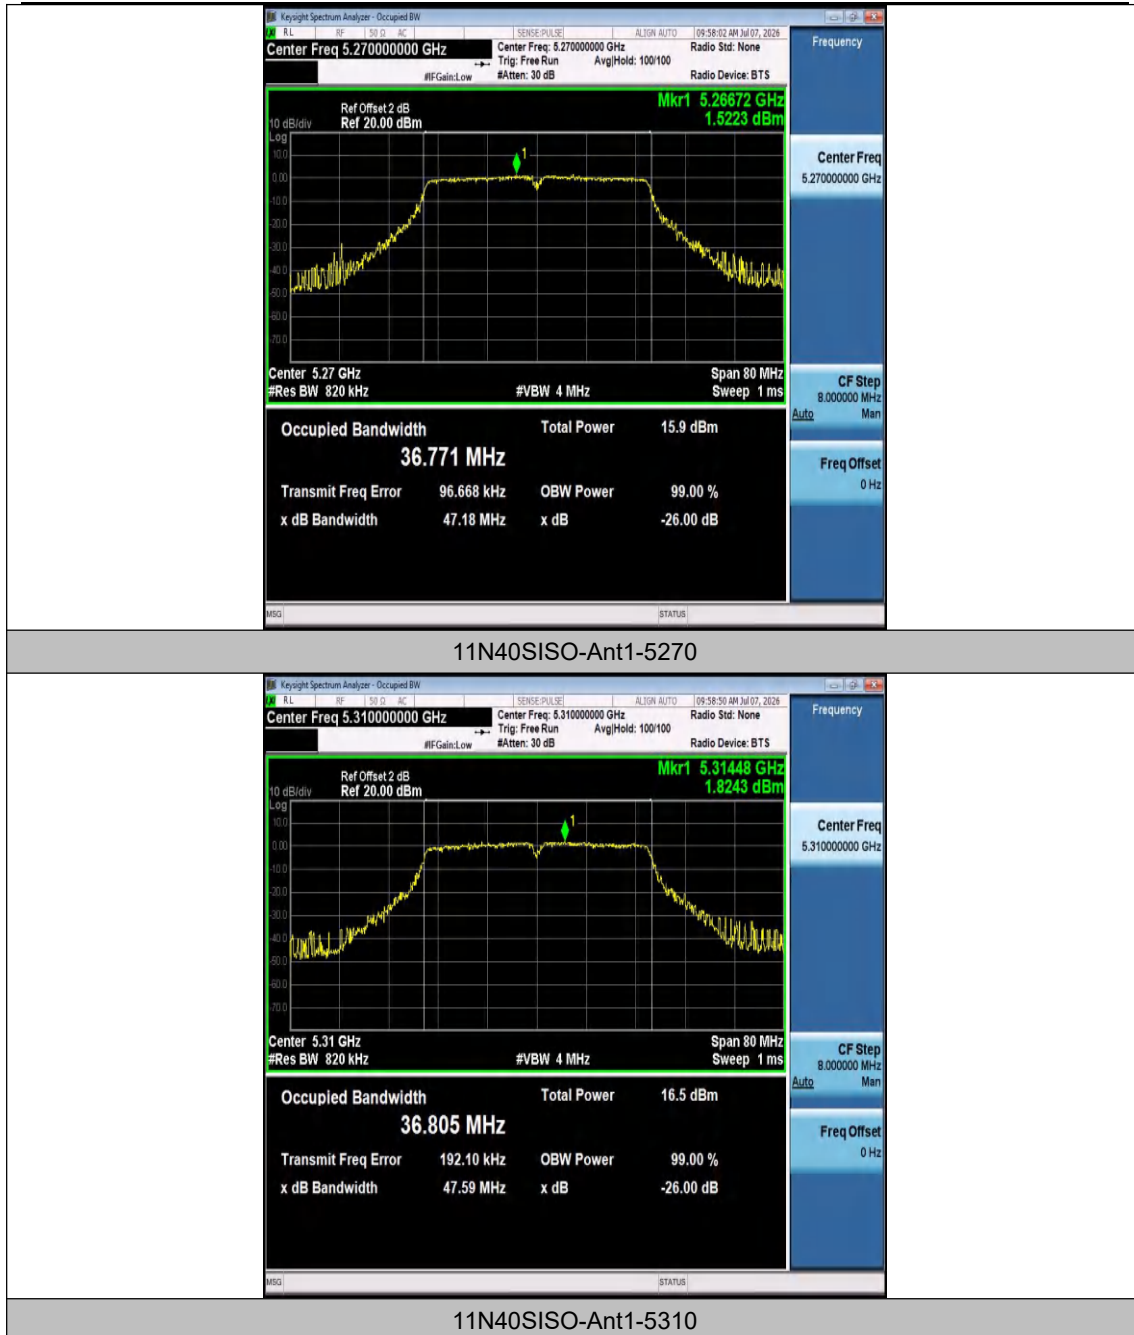

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

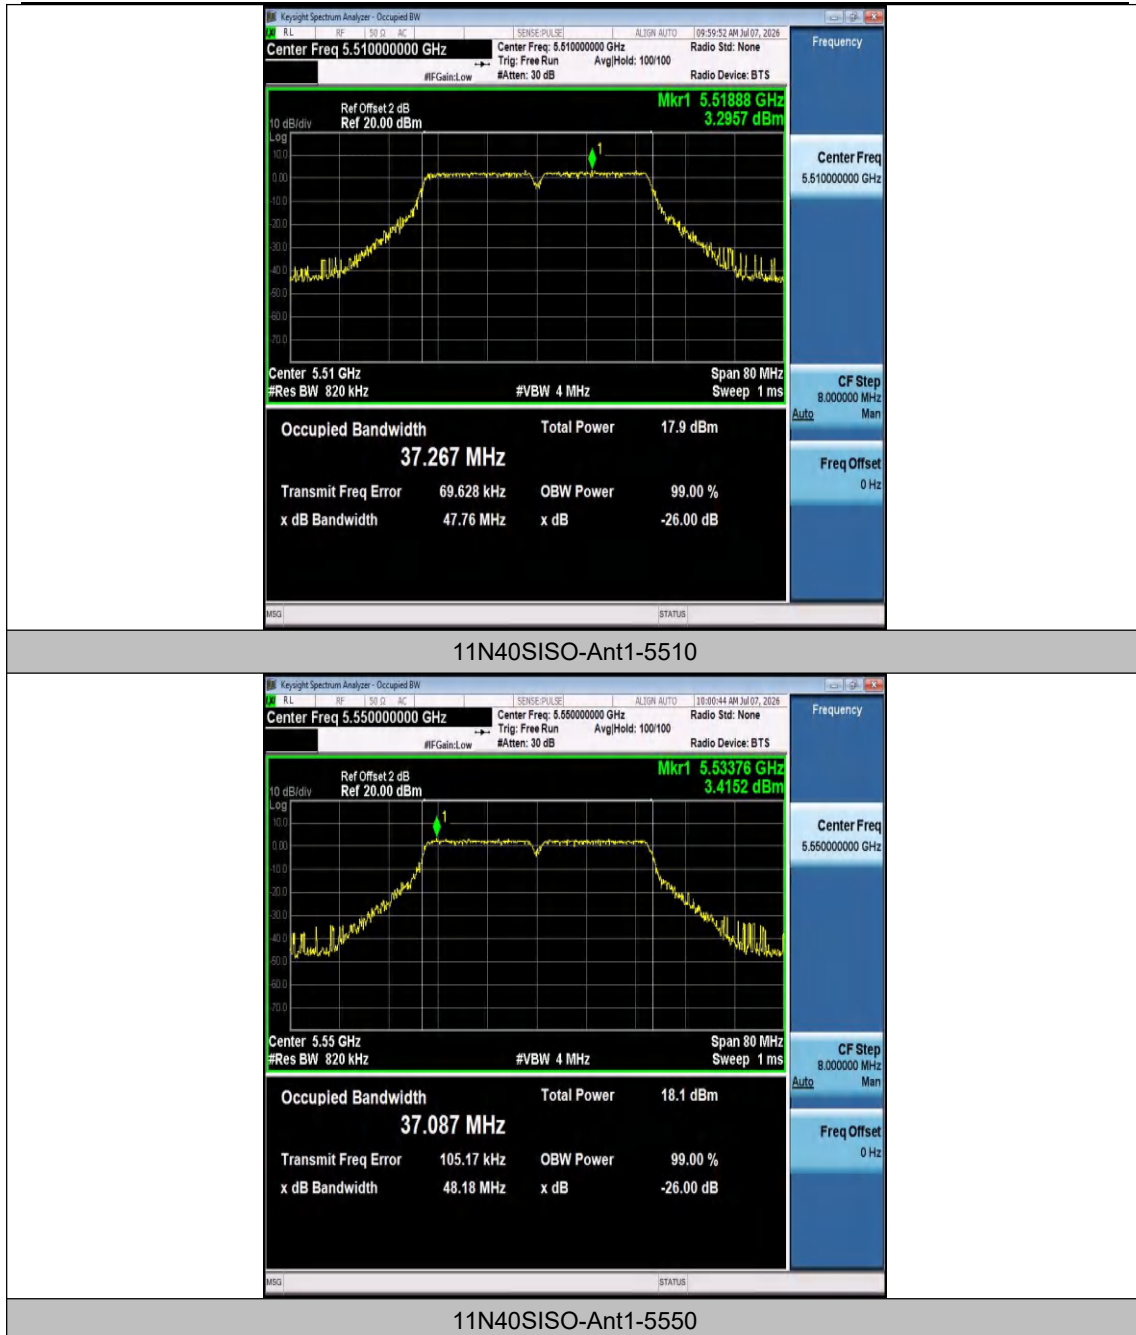

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

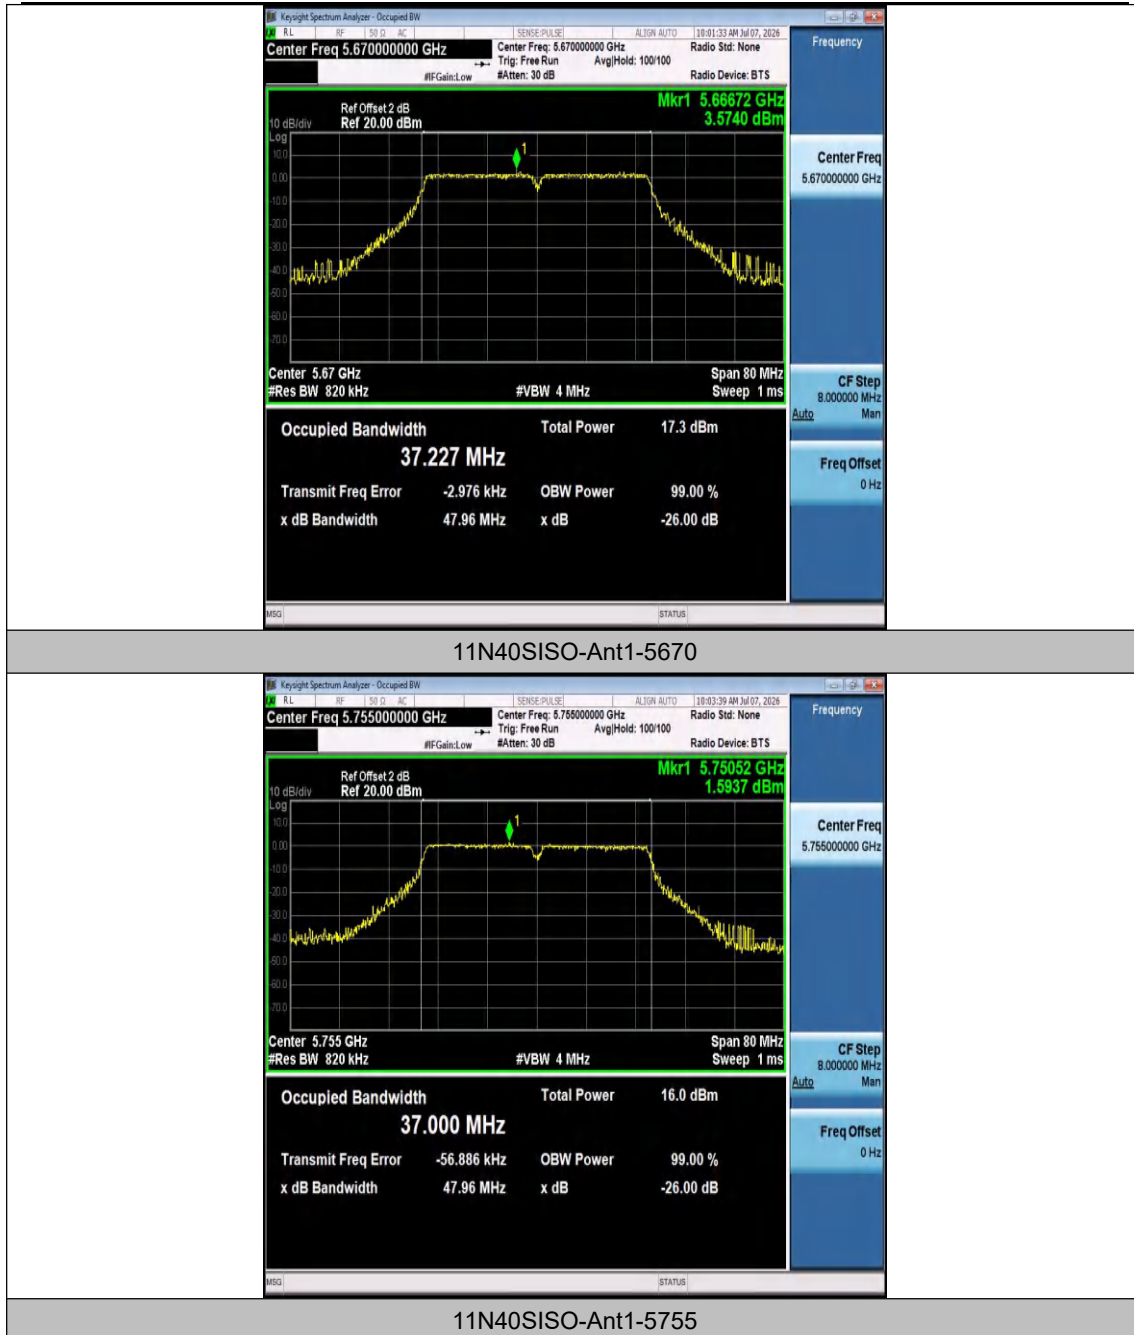

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

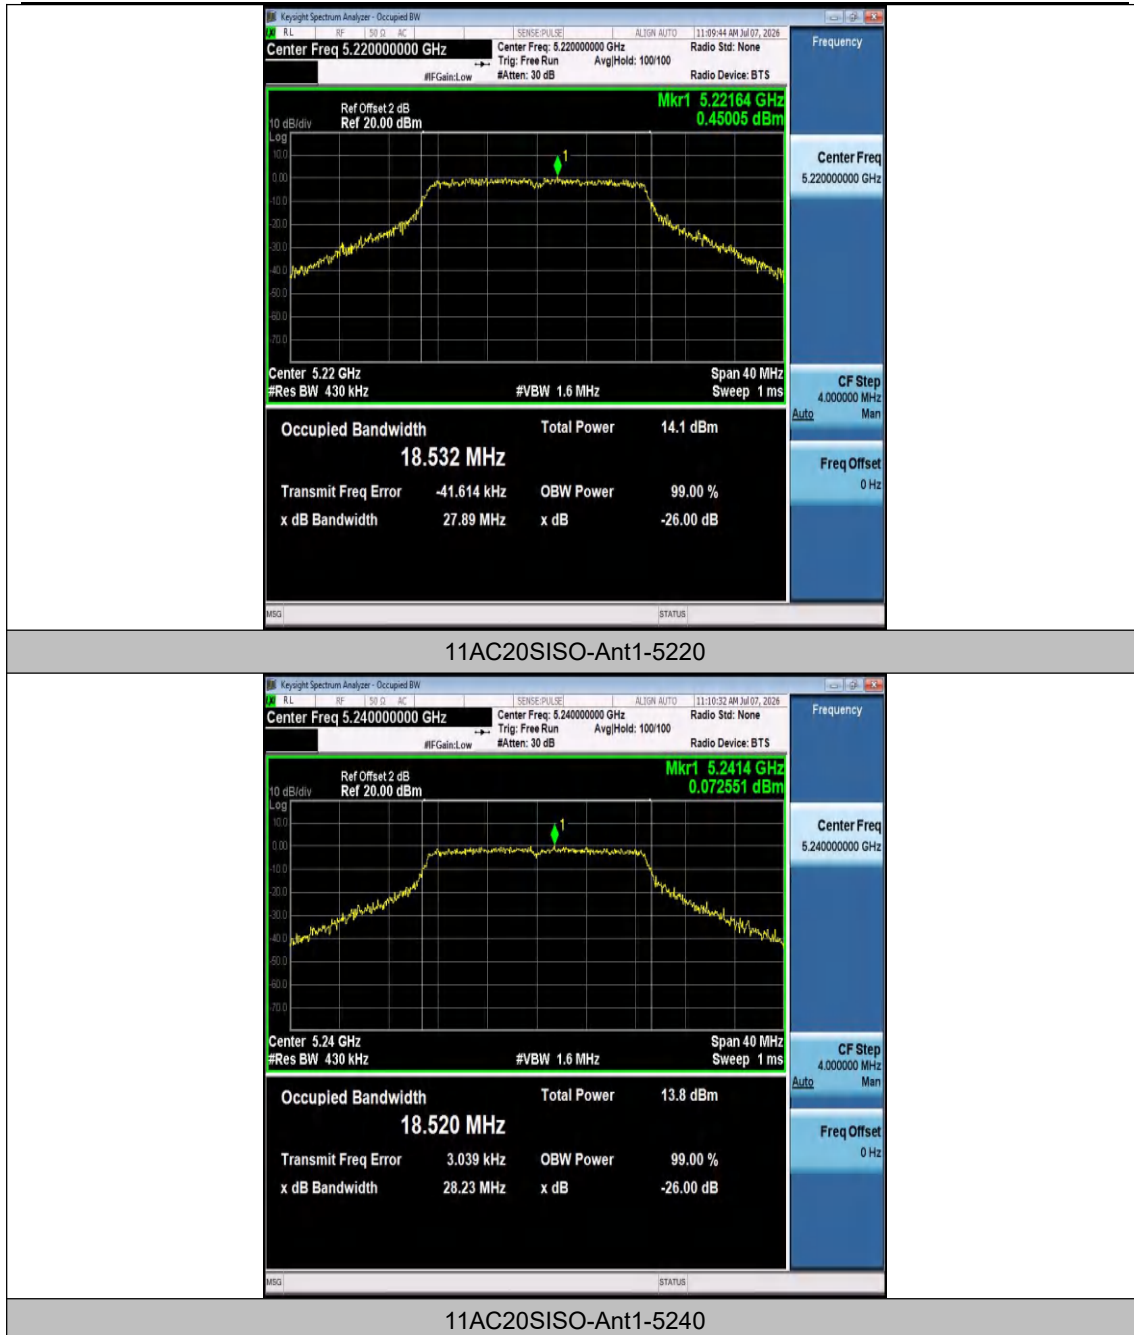

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com