

Appendix Test Data

Report No.:	1812C60000412503-01	Test Sample No.:	1-2-2
Start Test Date:	2026-1-6	Finish Test Date:	2026-1-8
Test Engineer:	<i>Alex Peng</i>	Auditor:	<i>Justin Feng</i>
Temperature:	18.6°C	Relative Humidity:	43%
Pressure:	101kPa		

Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	25.320	5167.040	5192.360	---	---
11A	Ant1	5220	25.880	5206.320	5232.200	---	---
11A	Ant1	5240	26.920	5226.480	5253.400	---	---
11A	Ant1	5260	26.200	5247.120	5273.320	---	---
11A	Ant1	5300	27.440	5286.240	5313.680	---	---
11A	Ant1	5320	26.640	5306.840	5333.480	---	---
11A	Ant1	5500	27.480	5486.480	5513.960	---	---
11A	Ant1	5580	26.640	5566.560	5593.200	---	---
11A	Ant1	5700	27.920	5686.280	5714.200	---	---
11A	Ant1	5745	27.720	5731.040	5758.760	---	---
11A	Ant1	5785	26.920	5771.920	5798.840	---	---
11A	Ant1	5825	26.960	5811.120	5838.080	---	---
11N20SISO	Ant1	5180	26.160	5166.840	5193.000	---	---
11N20SISO	Ant1	5220	25.400	5207.200	5232.600	---	---
11N20SISO	Ant1	5240	25.440	5227.360	5252.800	---	---
11N20SISO	Ant1	5260	25.320	5247.960	5273.280	---	---
11N20SISO	Ant1	5300	27.440	5287.080	5314.520	---	---
11N20SISO	Ant1	5320	26.640	5306.680	5333.320	---	---
11N20SISO	Ant1	5500	26.640	5487.120	5513.760	---	---
11N20SISO	Ant1	5580	26.160	5567.360	5593.520	---	---
11N20SISO	Ant1	5700	27.520	5686.040	5713.560	---	---
11N20SISO	Ant1	5745	28.080	5730.520	5758.600	---	---
11N20SISO	Ant1	5785	26.200	5771.720	5797.920	---	---
11N20SISO	Ant1	5825	26.720	5811.960	5838.680	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11N40SISO	Ant1	5190	46.080	5166.640	5212.720	---	---
11N40SISO	Ant1	5230	45.360	5207.040	5252.400	---	---
11N40SISO	Ant1	5270	46.320	5247.360	5293.680	---	---
11N40SISO	Ant1	5310	45.200	5287.840	5333.040	---	---
11N40SISO	Ant1	5510	46.160	5487.280	5533.440	---	---
11N40SISO	Ant1	5550	45.920	5527.120	5573.040	---	---
11N40SISO	Ant1	5670	46.800	5646.400	5693.200	---	---
11N40SISO	Ant1	5755	46.000	5732.520	5778.520	---	---
11N40SISO	Ant1	5795	46.480	5772.280	5818.760	---	---
11AC20SISO	Ant1	5180	26.200	5167.200	5193.400	---	---
11AC20SISO	Ant1	5220	25.000	5207.240	5232.240	---	---
11AC20SISO	Ant1	5240	26.560	5226.920	5253.480	---	---
11AC20SISO	Ant1	5260	26.960	5246.240	5273.200	---	---
11AC20SISO	Ant1	5300	27.200	5286.800	5314.000	---	---
11AC20SISO	Ant1	5320	25.760	5307.120	5332.880	---	---
11AC20SISO	Ant1	5500	27.080	5486.920	5514.000	---	---
11AC20SISO	Ant1	5580	27.040	5566.120	5593.160	---	---
11AC20SISO	Ant1	5700	26.280	5686.920	5713.200	---	---
11AC20SISO	Ant1	5745	27.040	5732.040	5759.080	---	---
11AC20SISO	Ant1	5785	26.680	5771.280	5797.960	---	---
11AC20SISO	Ant1	5825	26.160	5812.160	5838.320	---	---
11AC40SISO	Ant1	5190	45.680	5167.040	5212.720	---	---
11AC40SISO	Ant1	5230	46.160	5206.800	5252.960	---	---
11AC40SISO	Ant1	5270	45.280	5247.600	5292.880	---	---
11AC40SISO	Ant1	5310	45.120	5287.760	5332.880	---	---
11AC40SISO	Ant1	5510	46.800	5486.720	5533.520	---	---
11AC40SISO	Ant1	5550	47.680	5526.880	5574.560	---	---
11AC40SISO	Ant1	5670	46.000	5646.400	5692.400	---	---
11AC40SISO	Ant1	5755	46.560	5732.360	5778.920	---	---
11AC40SISO	Ant1	5795	46.480	5771.400	5817.880	---	---
11AC80SISO	Ant1	5210	89.920	5165.040	5254.960	---	---
11AC80SISO	Ant1	5290	89.440	5245.520	5334.960	---	---
11AC80SISO	Ant1	5530	89.440	5486.000	5575.440	---	---
11AC80SISO	Ant1	5775	98.240	5722.520	5820.760	---	---
11AX20SISO	Ant1	5180	29.160	5167.200	5196.360	---	---
11AX20SISO	Ant1	5220	28.520	5207.280	5235.800	---	---
11AX20SISO	Ant1	5240	28.440	5227.600	5256.040	---	---
11AX20SISO	Ant1	5260	28.640	5247.240	5275.880	---	---
11AX20SISO	Ant1	5300	29.600	5287.000	5316.600	---	---
11AX20SISO	Ant1	5320	29.600	5306.920	5336.520	---	---
11AX20SISO	Ant1	5500	29.240	5487.600	5516.840	---	---
11AX20SISO	Ant1	5580	30.640	5566.920	5597.560	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


11AX20SISO	Ant1	5700	28.680	5687.600	5716.280	---	---
11AX20SISO	Ant1	5745	28.920	5732.480	5761.400	---	---
11AX20SISO	Ant1	5785	29.840	5771.880	5801.720	---	---
11AX20SISO	Ant1	5825	30.120	5811.560	5841.680	---	---
11AX40SISO	Ant1	5190	50.400	5164.240	5214.640	---	---
11AX40SISO	Ant1	5230	54.240	5202.160	5256.400	---	---
11AX40SISO	Ant1	5270	52.560	5243.520	5296.080	---	---
11AX40SISO	Ant1	5310	51.680	5284.960	5336.640	---	---
11AX40SISO	Ant1	5510	55.040	5483.920	5538.960	---	---
11AX40SISO	Ant1	5550	53.600	5524.080	5577.680	---	---
11AX40SISO	Ant1	5670	54.560	5642.720	5697.280	---	---
11AX40SISO	Ant1	5755	56.720	5725.960	5782.680	---	---
11AX40SISO	Ant1	5795	52.240	5768.600	5820.840	---	---
11AX80SISO	Ant1	5210	87.360	5166.320	5253.680	---	---
11AX80SISO	Ant1	5290	84.960	5247.920	5332.880	---	---
11AX80SISO	Ant1	5530	87.360	5487.760	5575.120	---	---
11AX80SISO	Ant1	5775	89.920	5729.880	5819.800	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

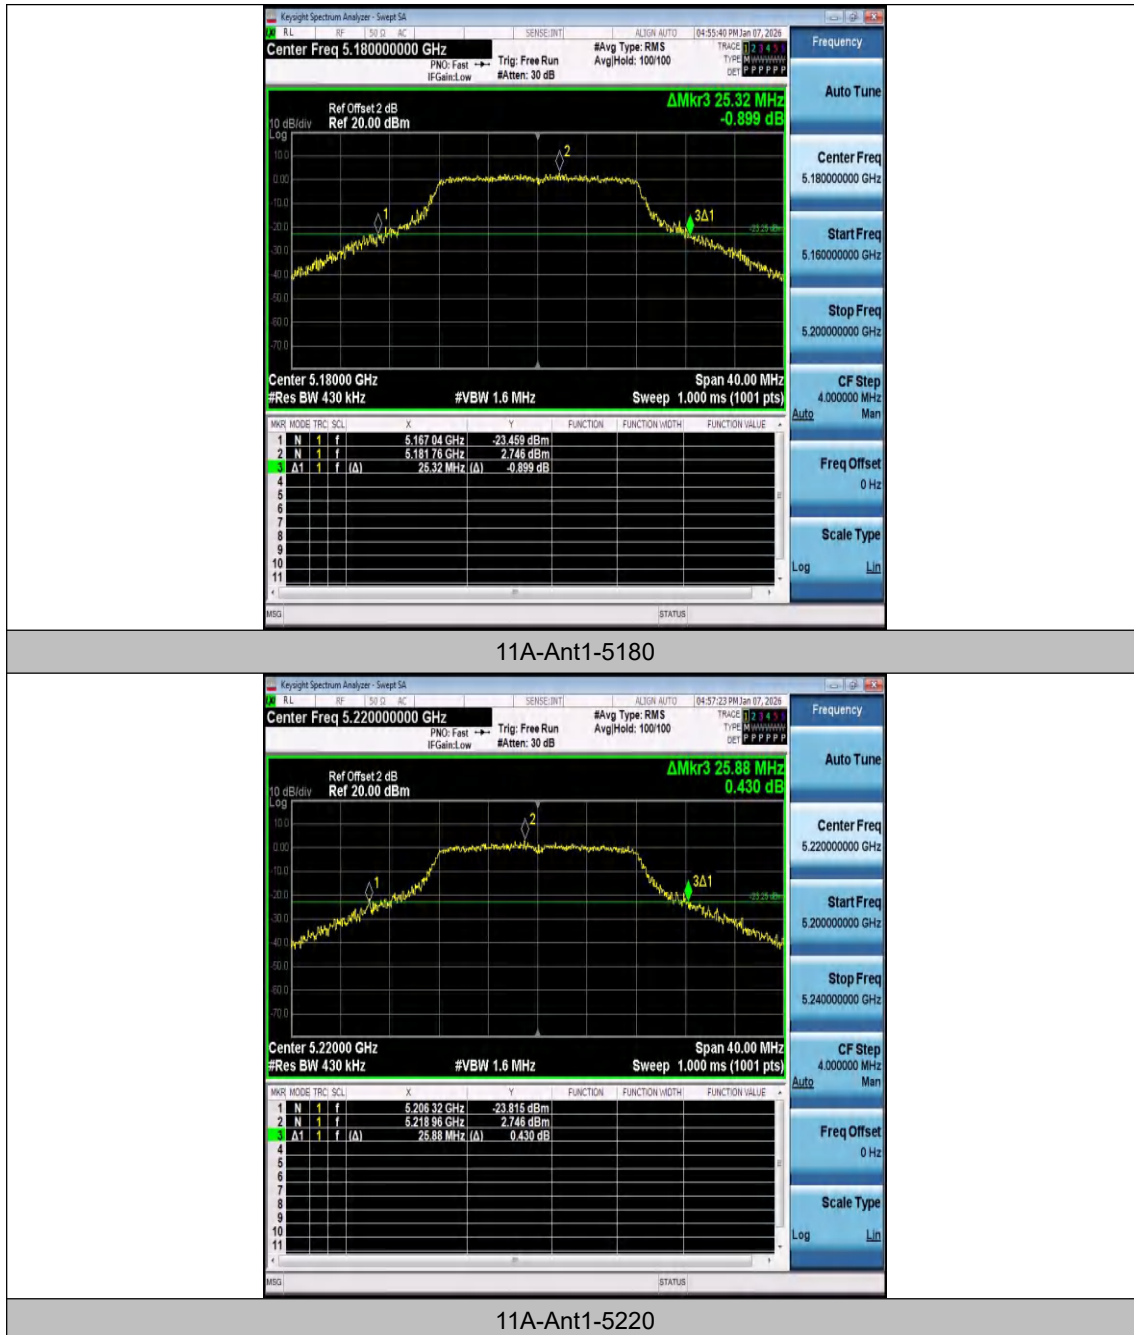

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

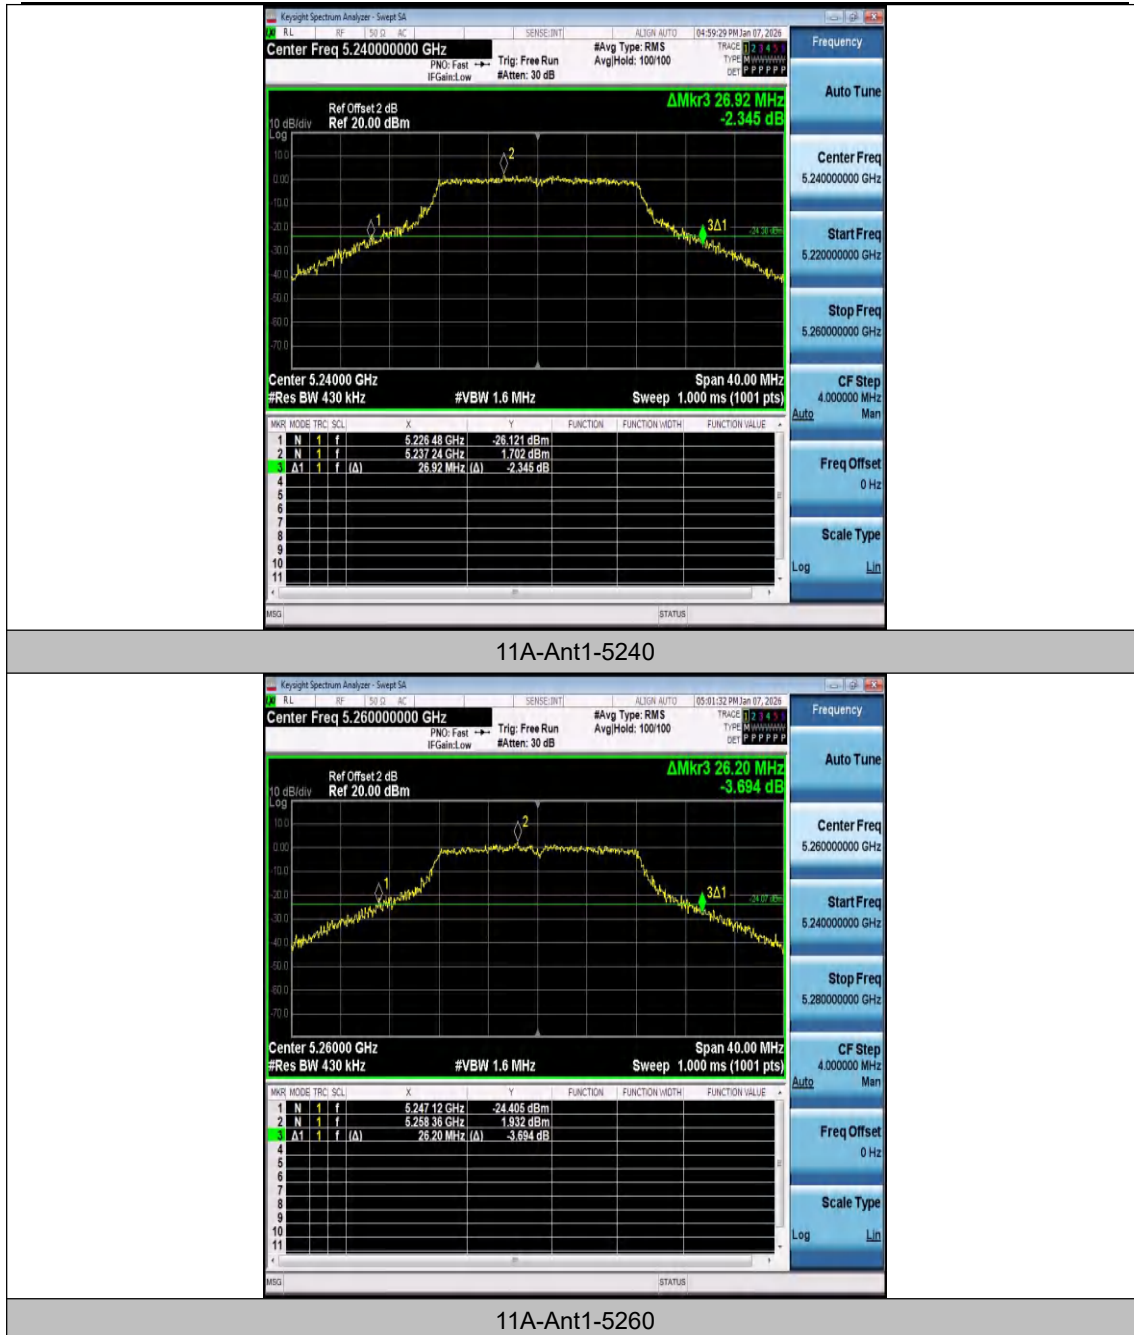

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

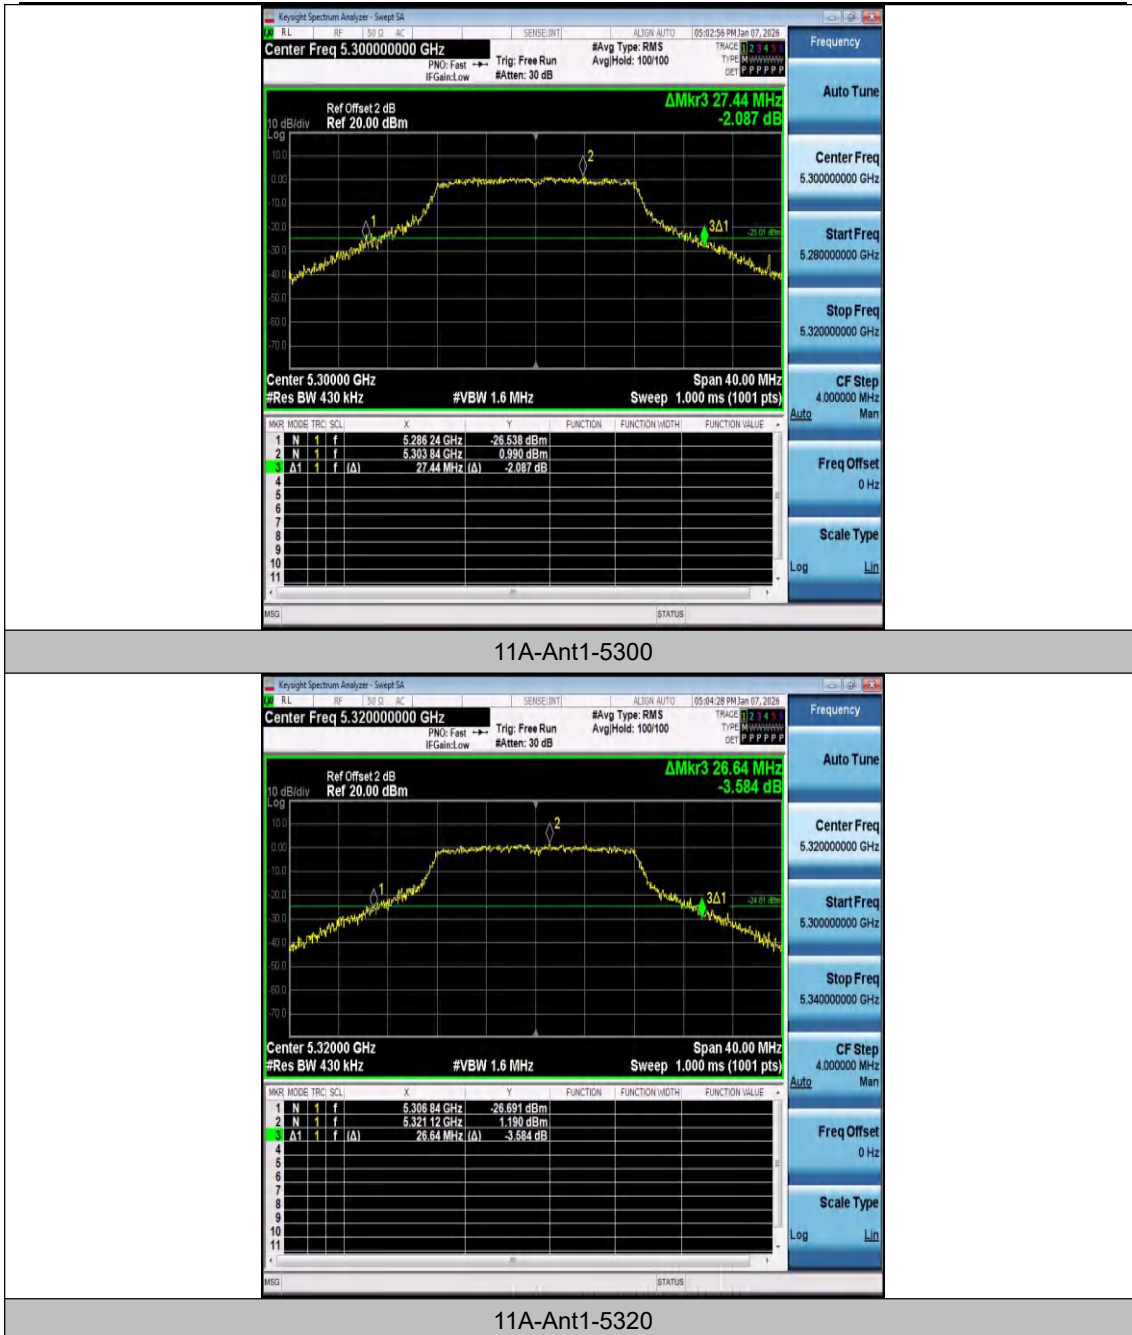

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

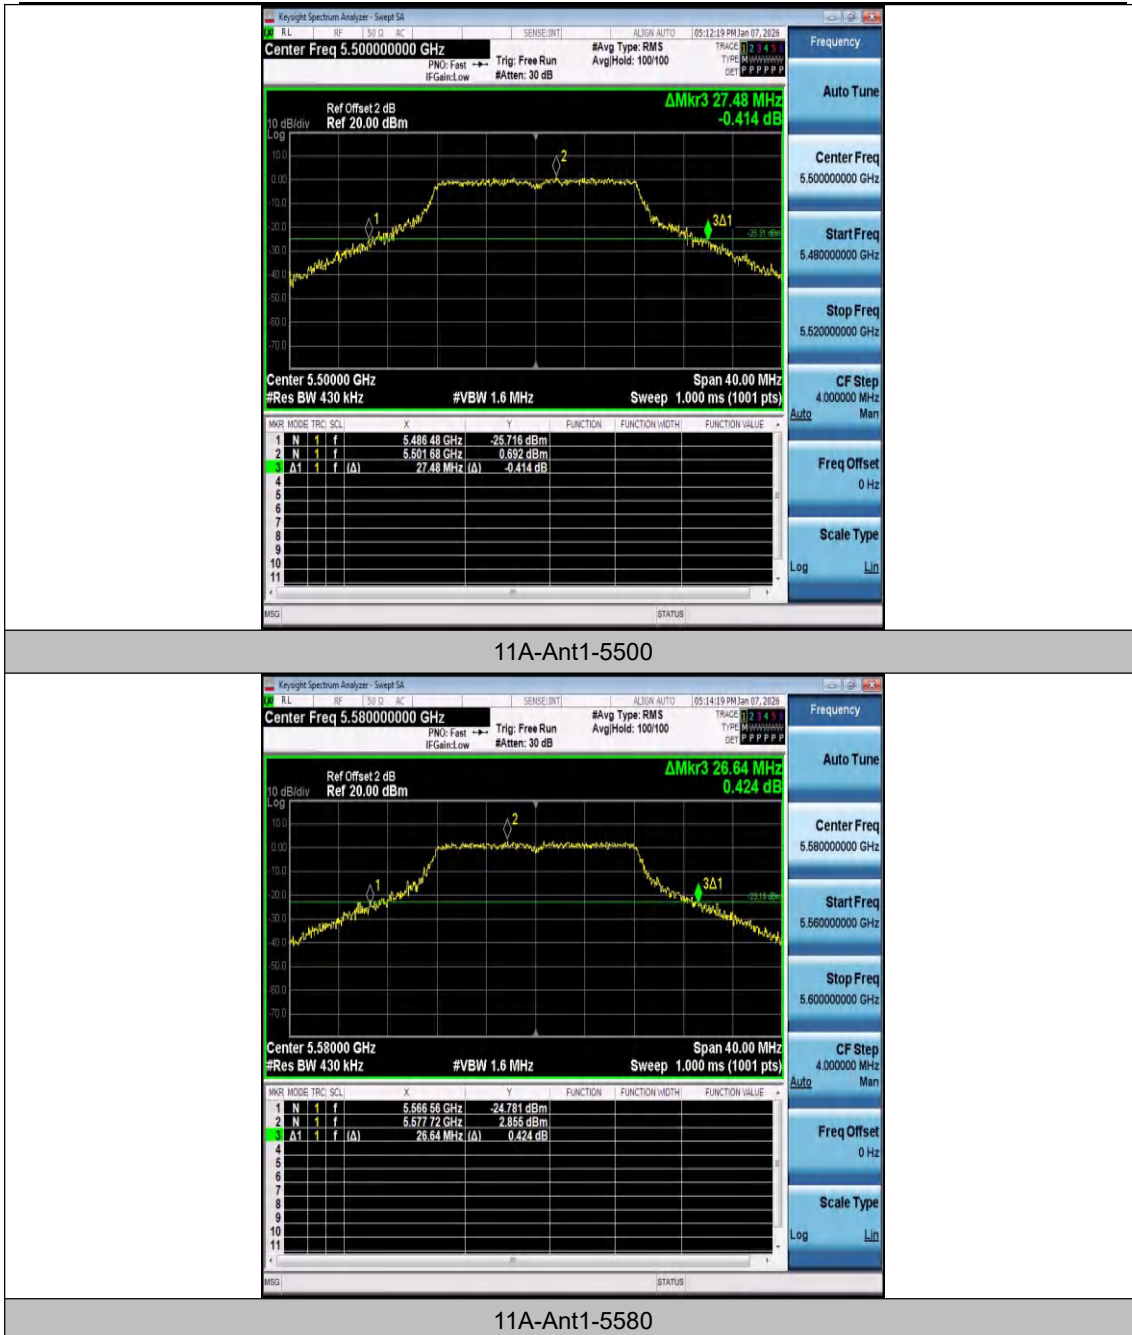


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




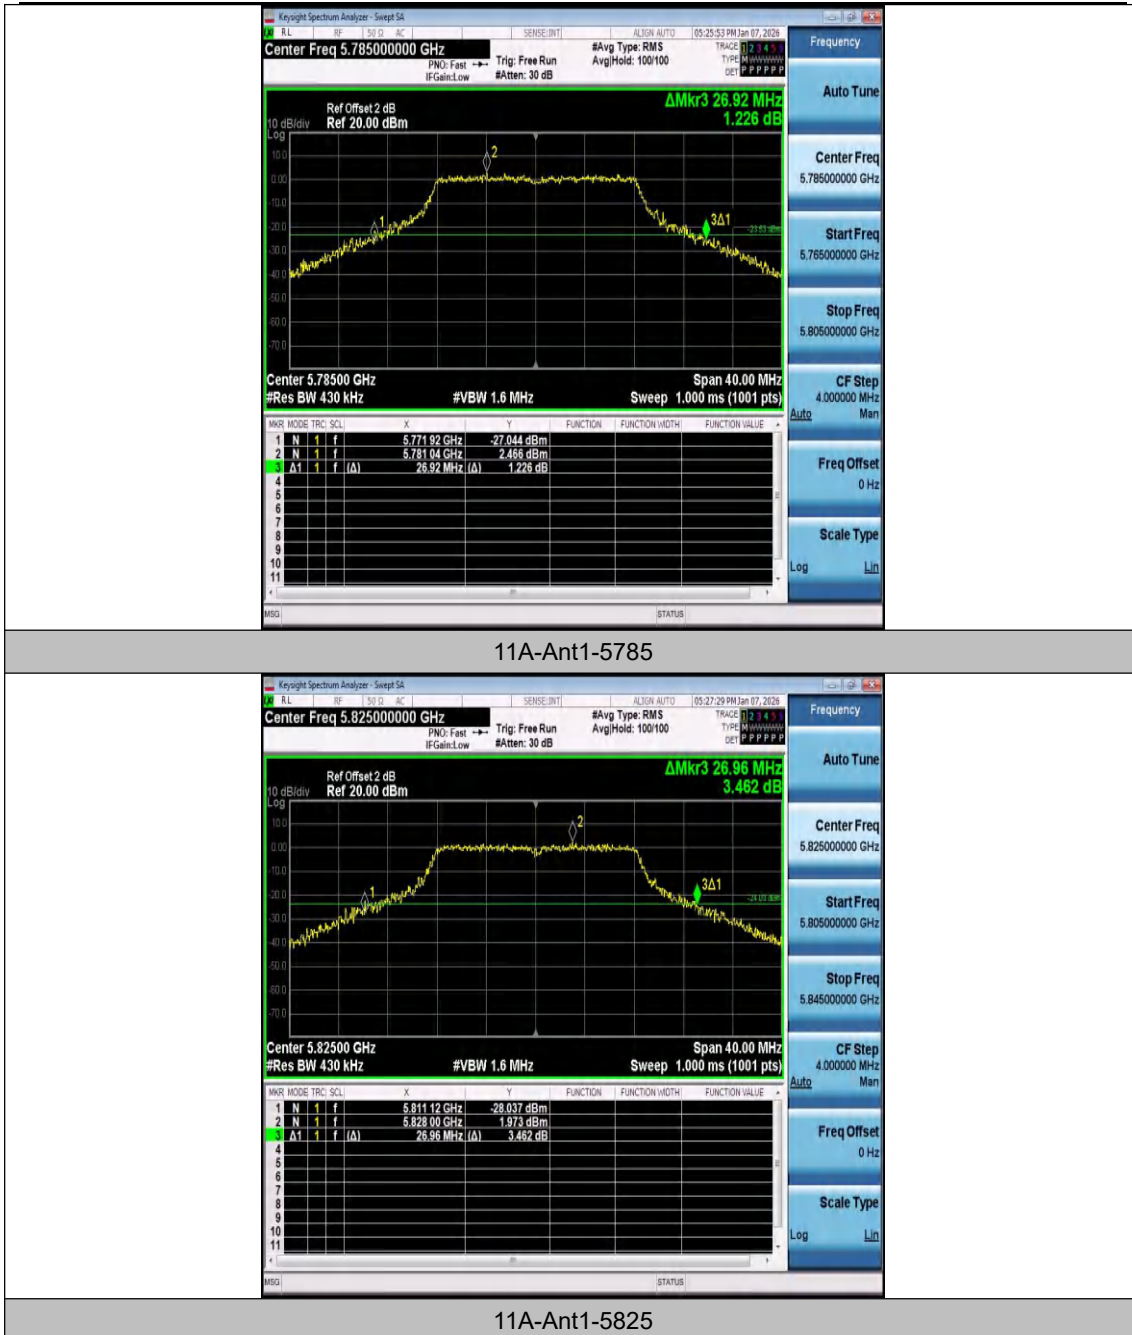


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

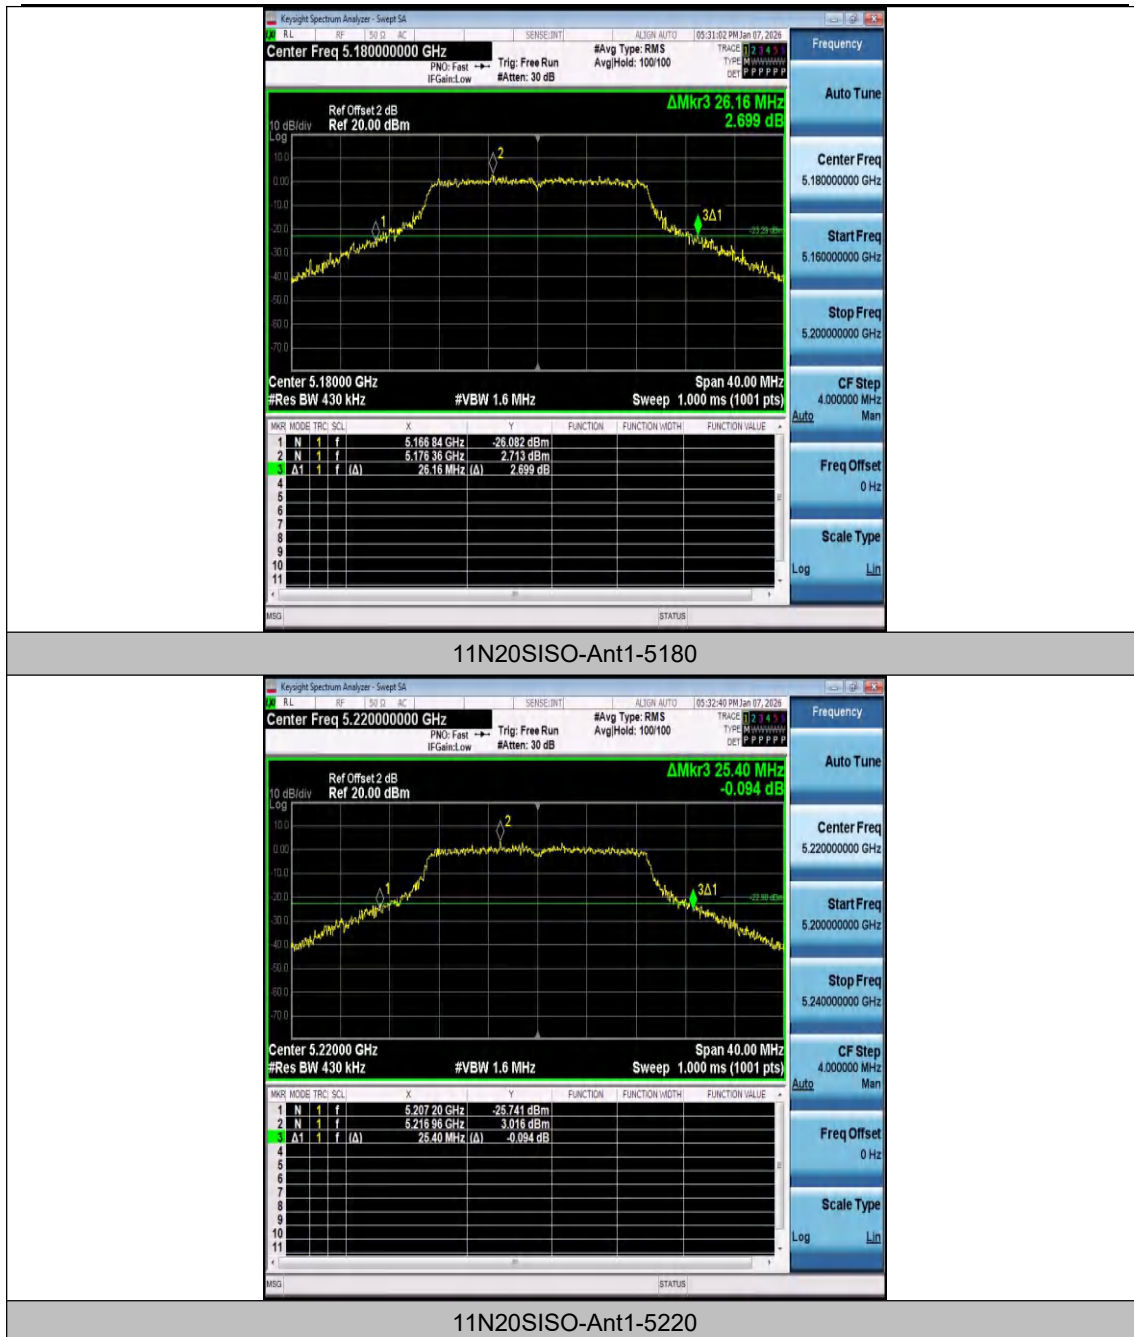


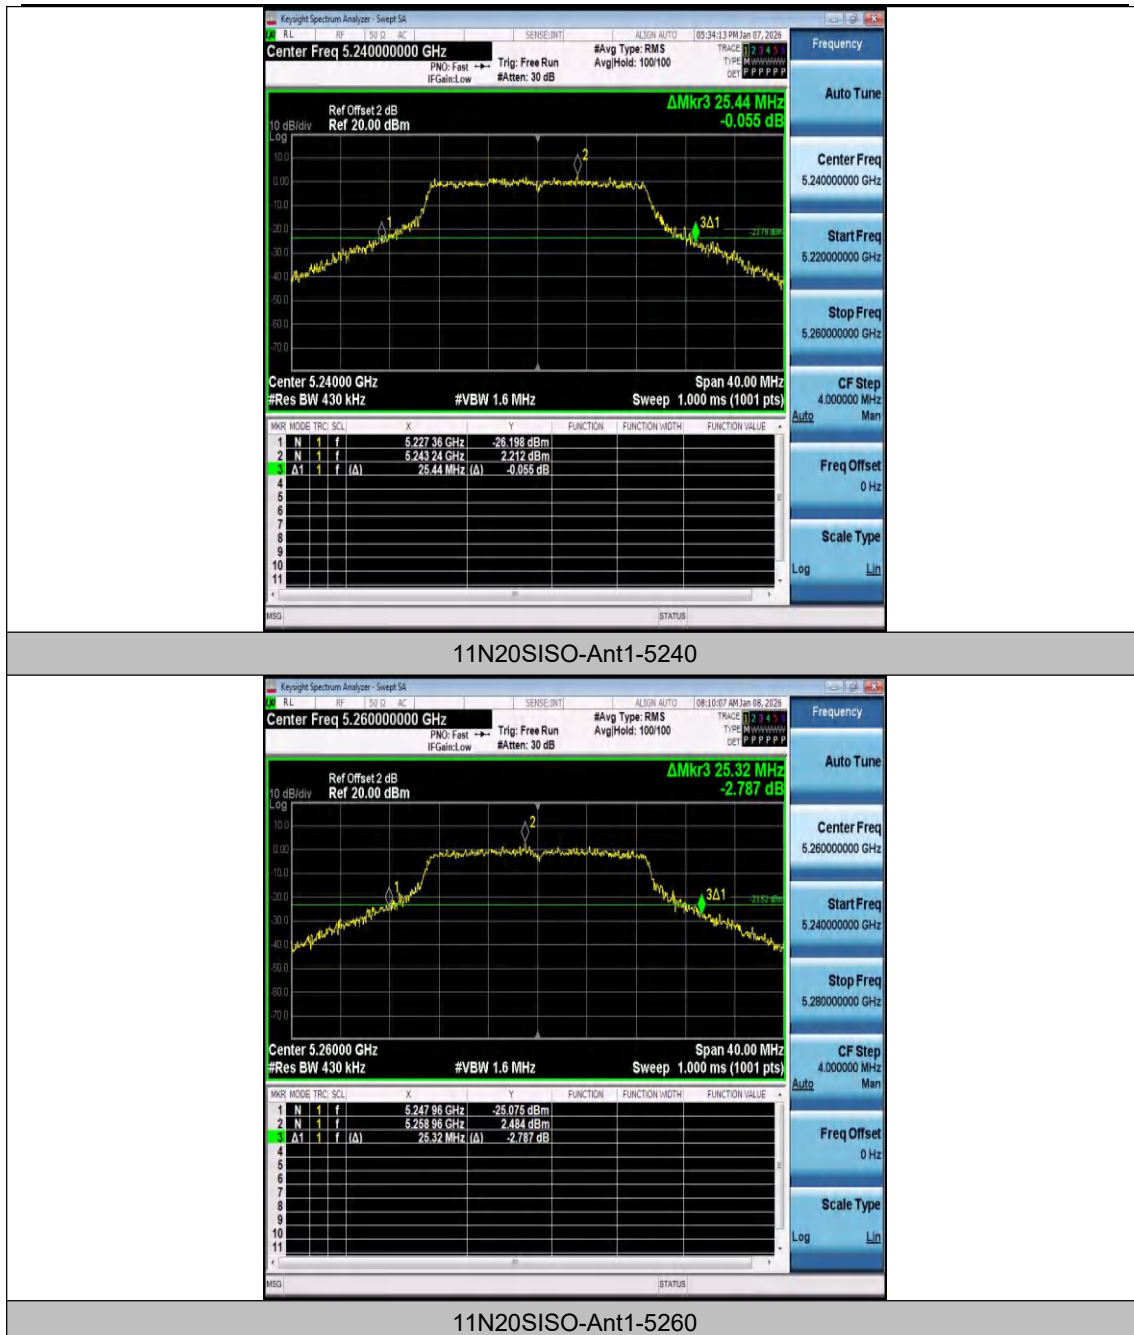

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

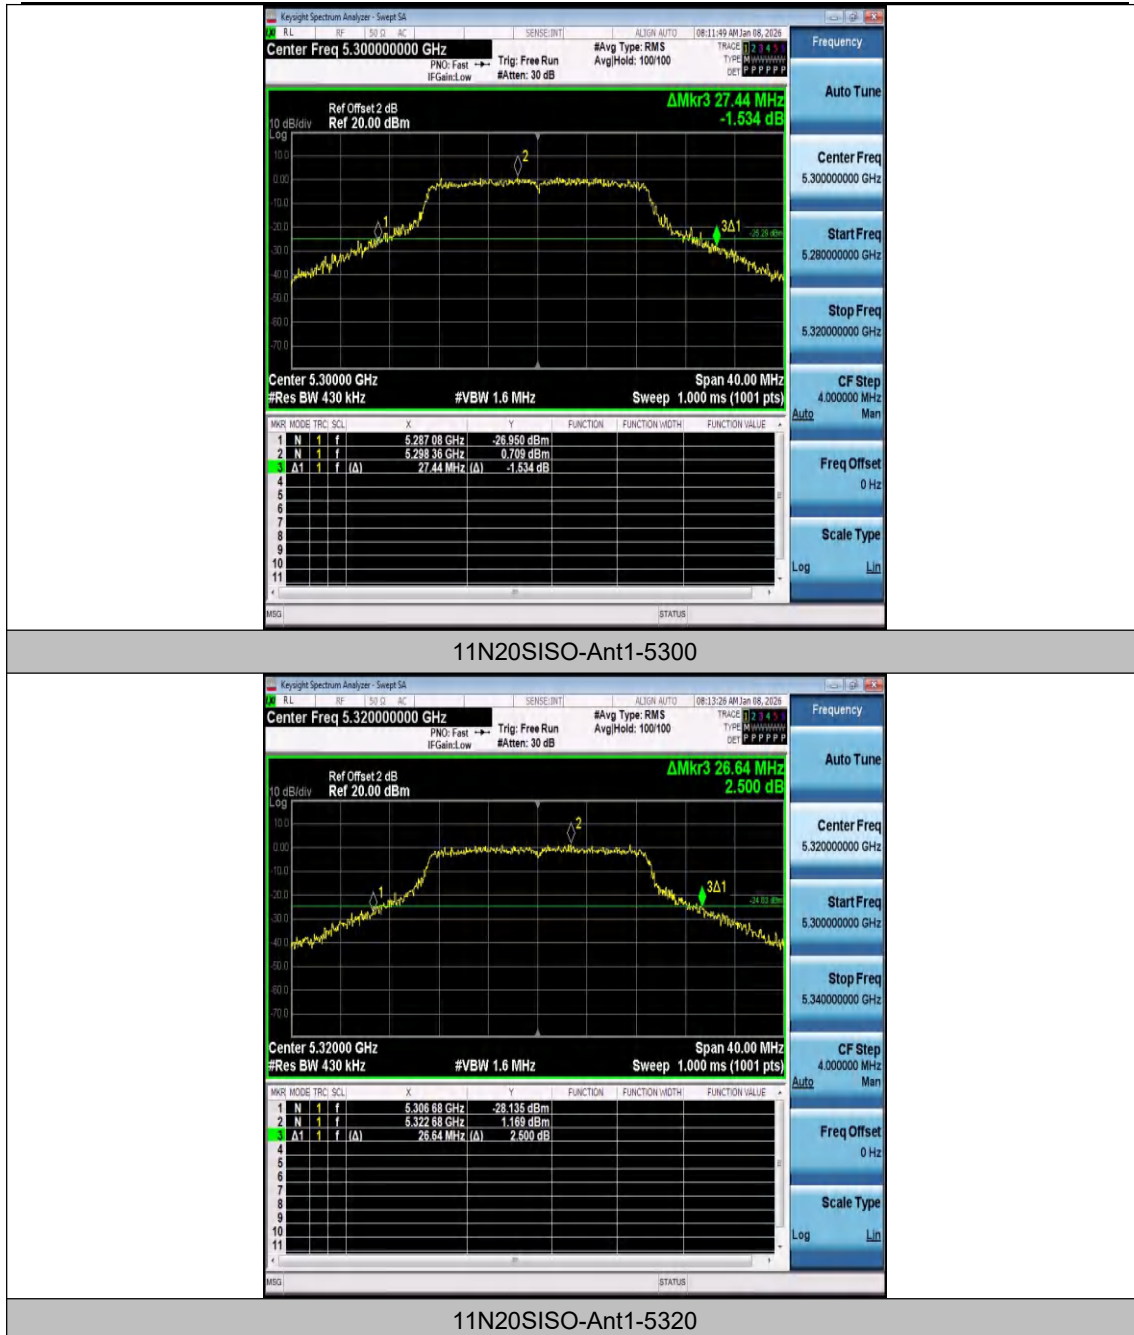


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

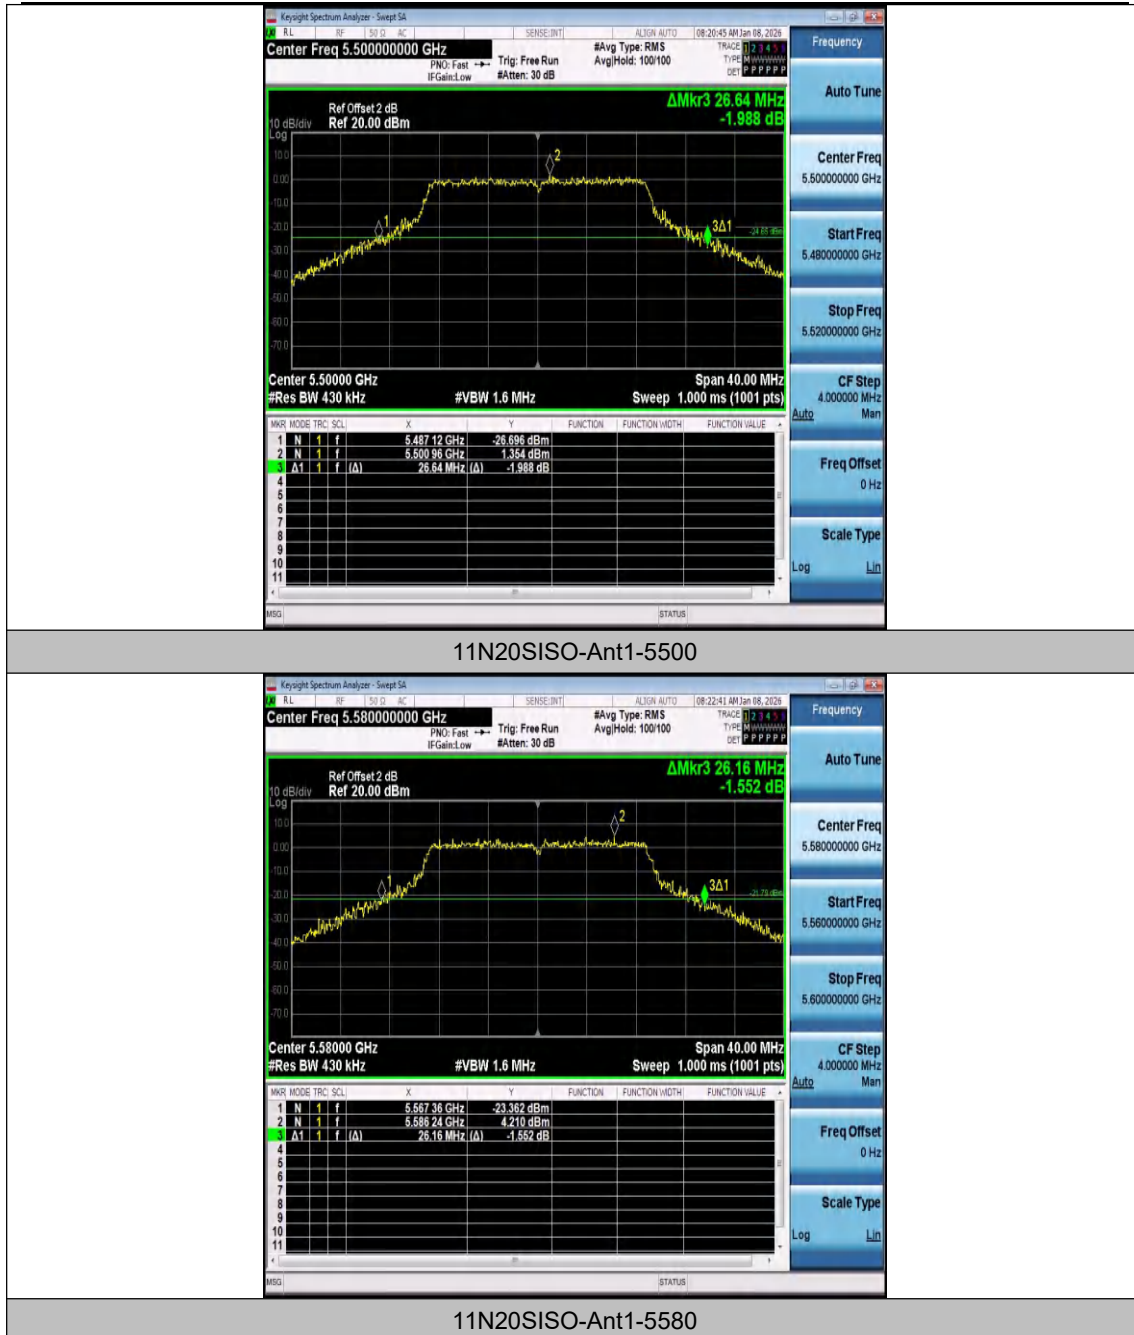


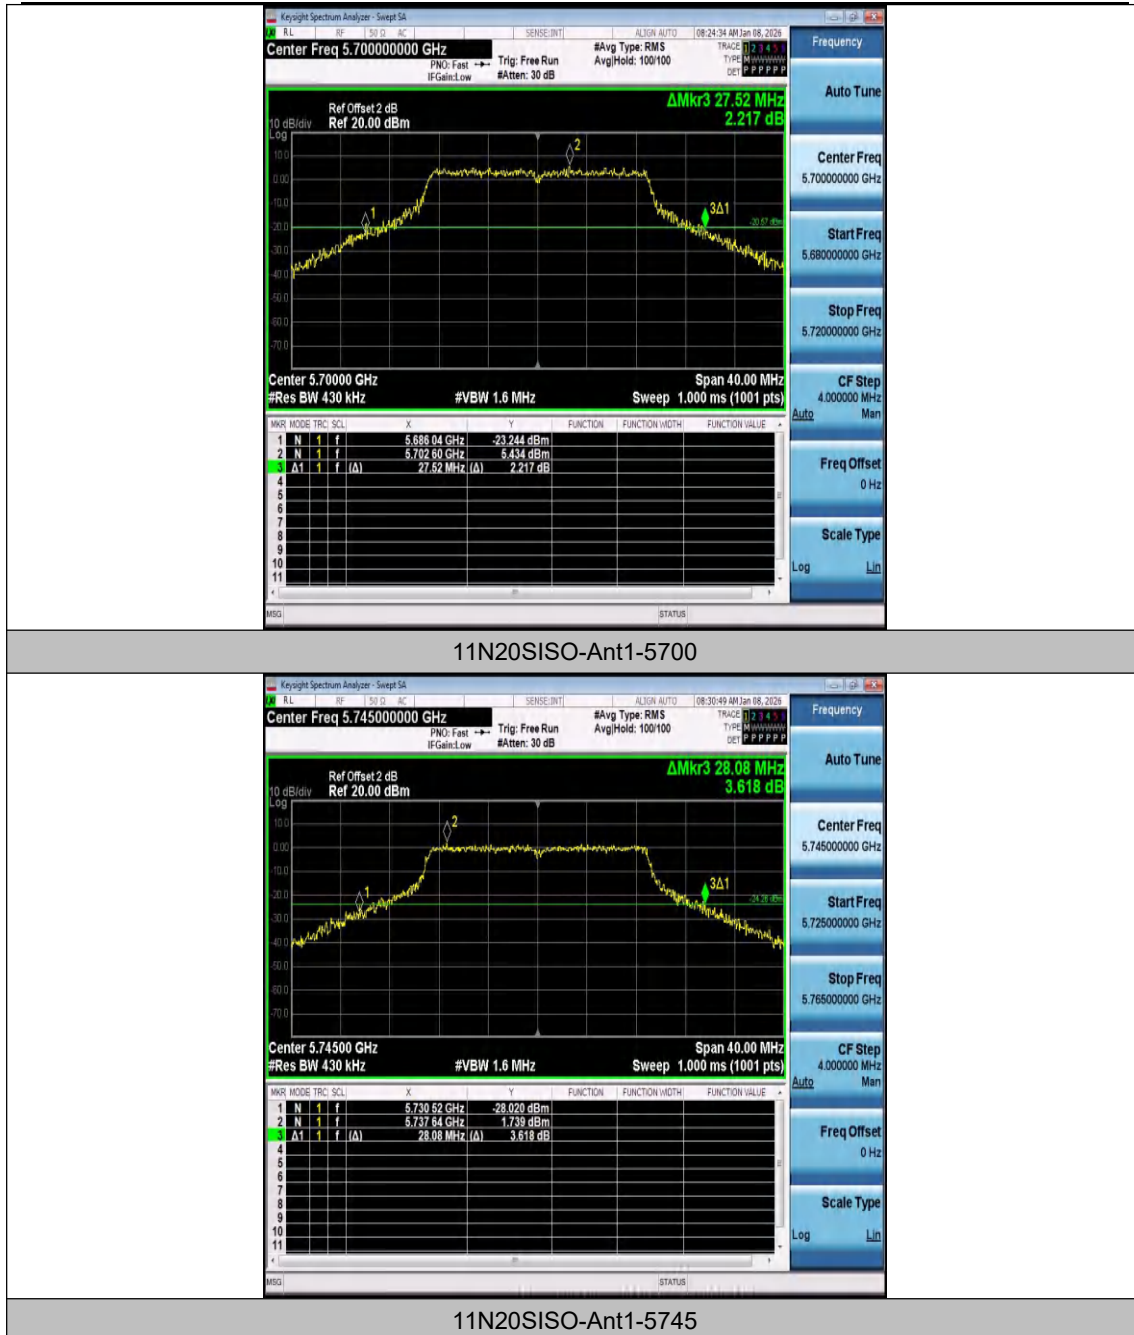

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

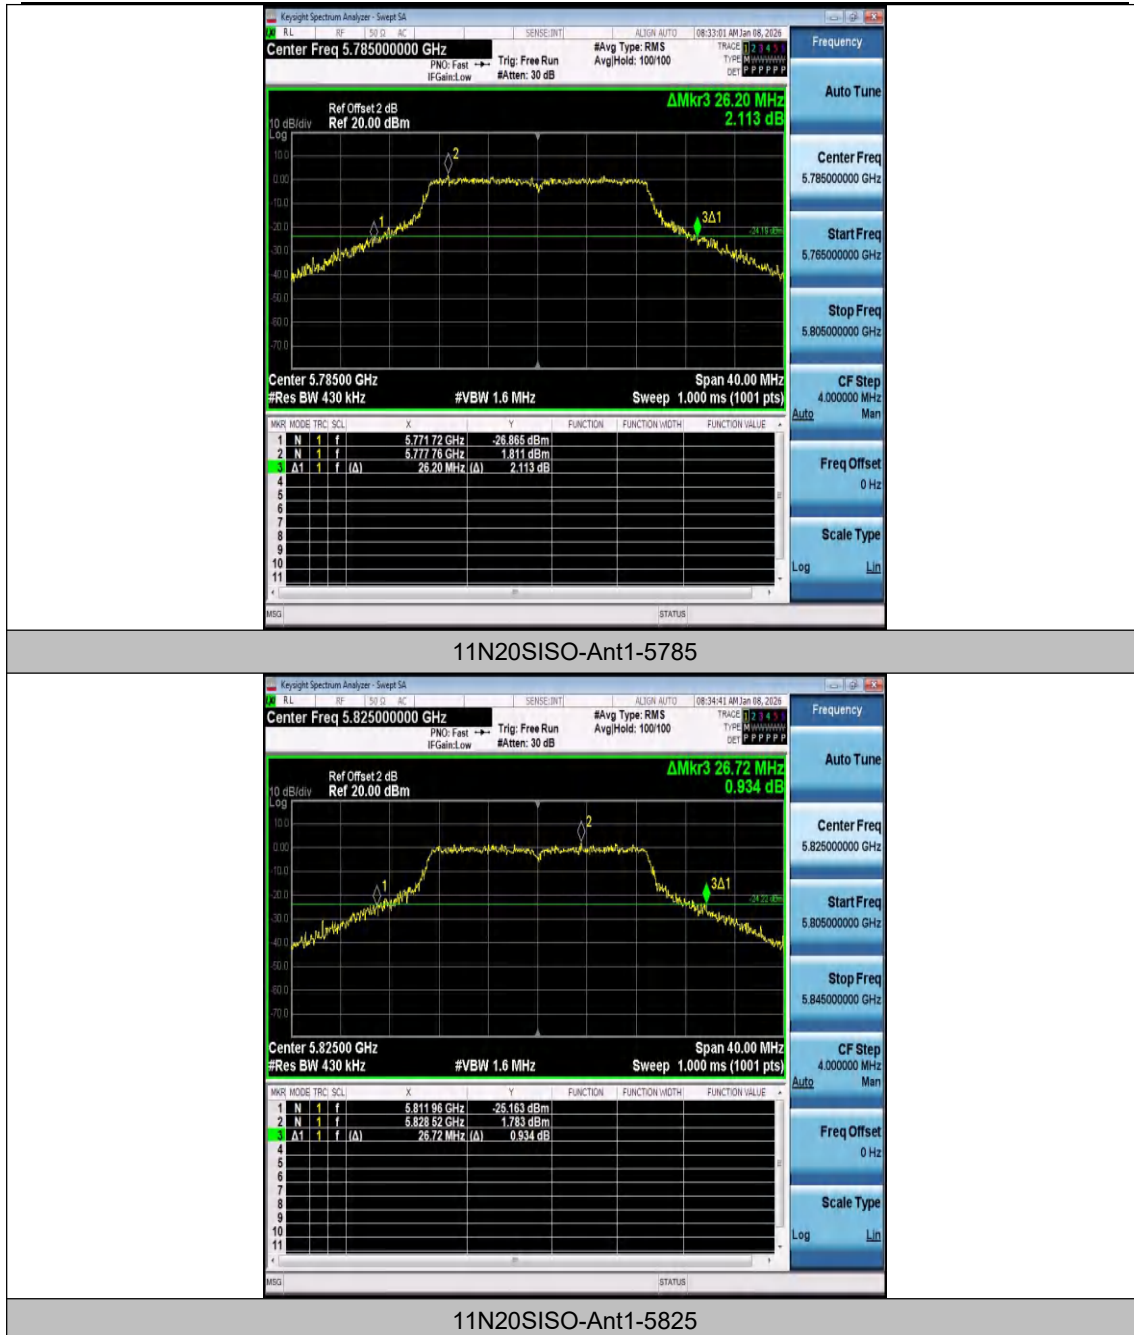



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

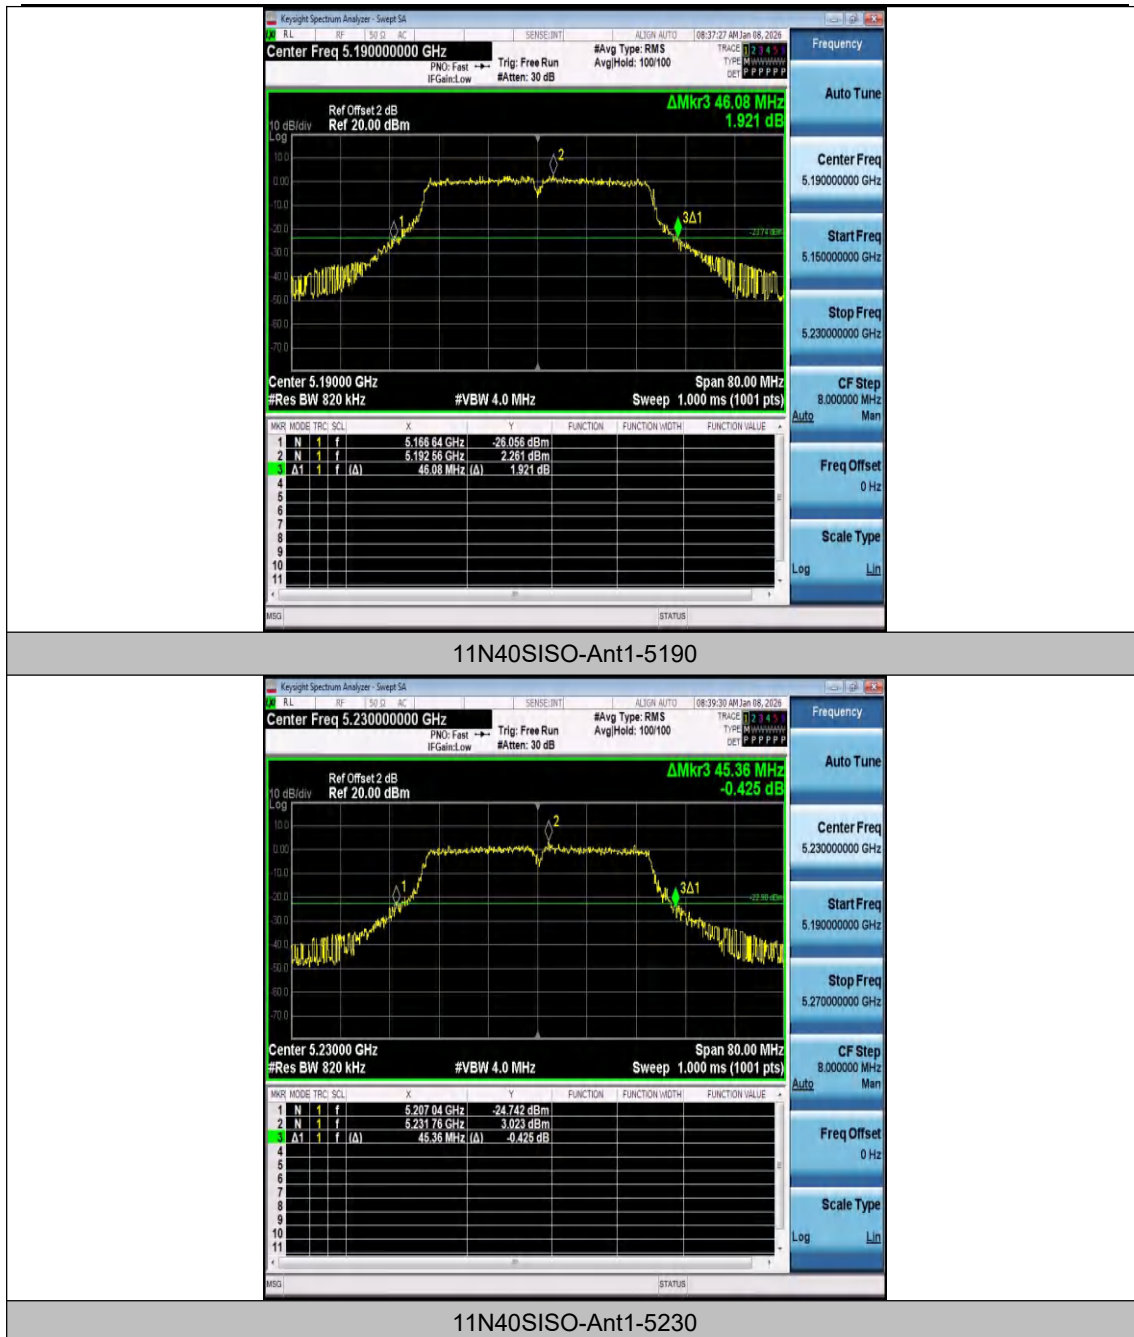

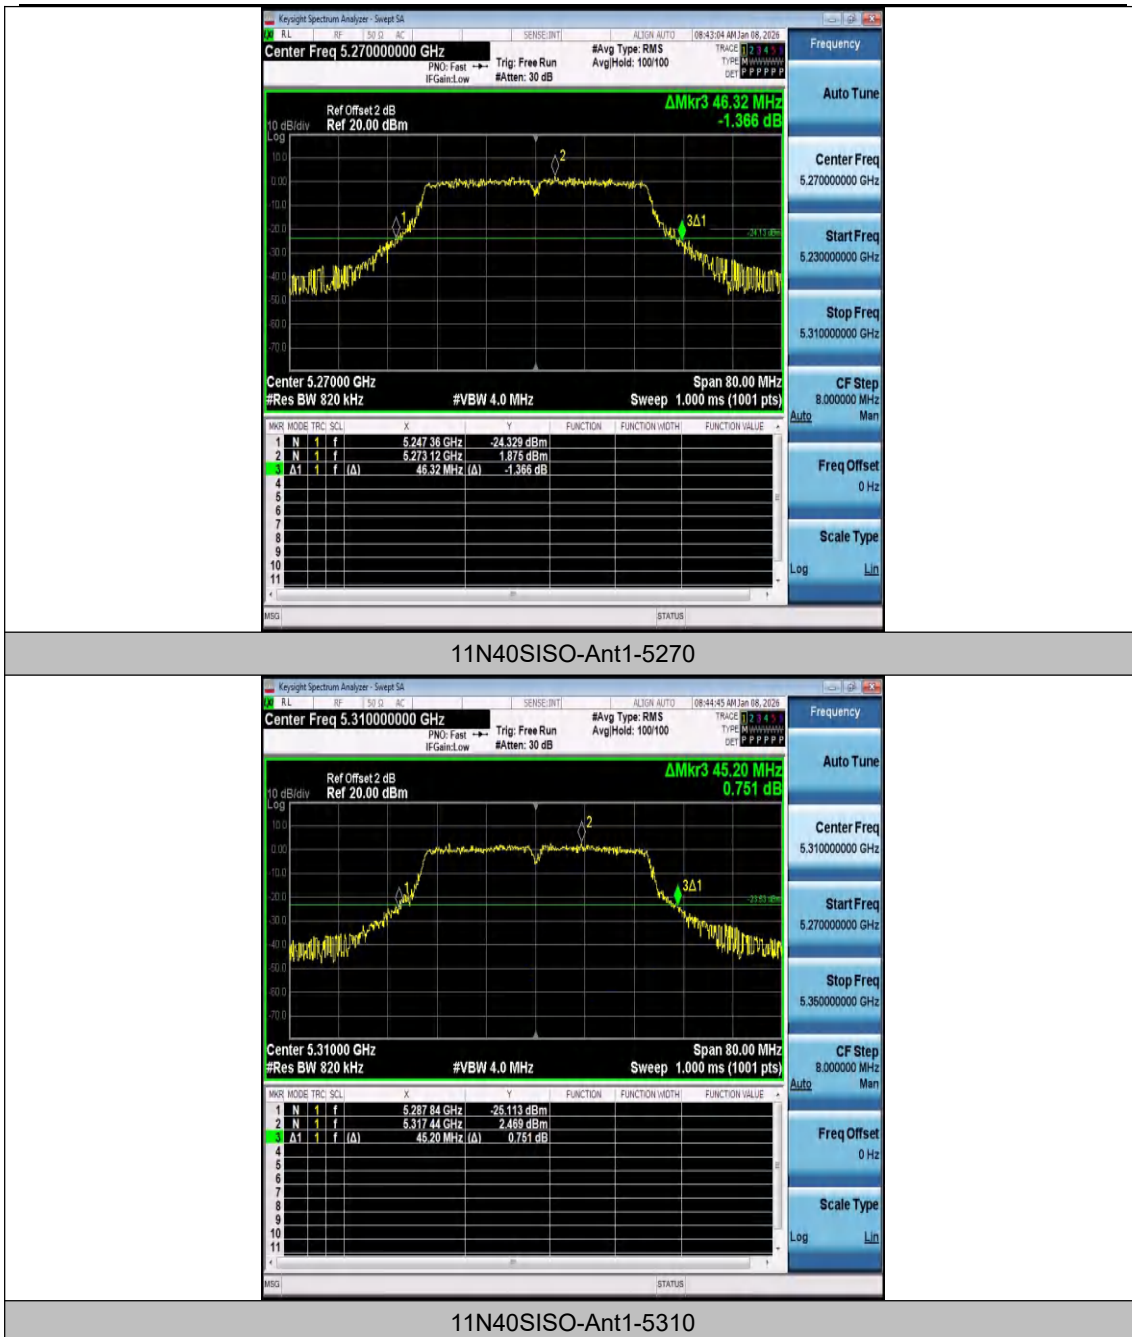


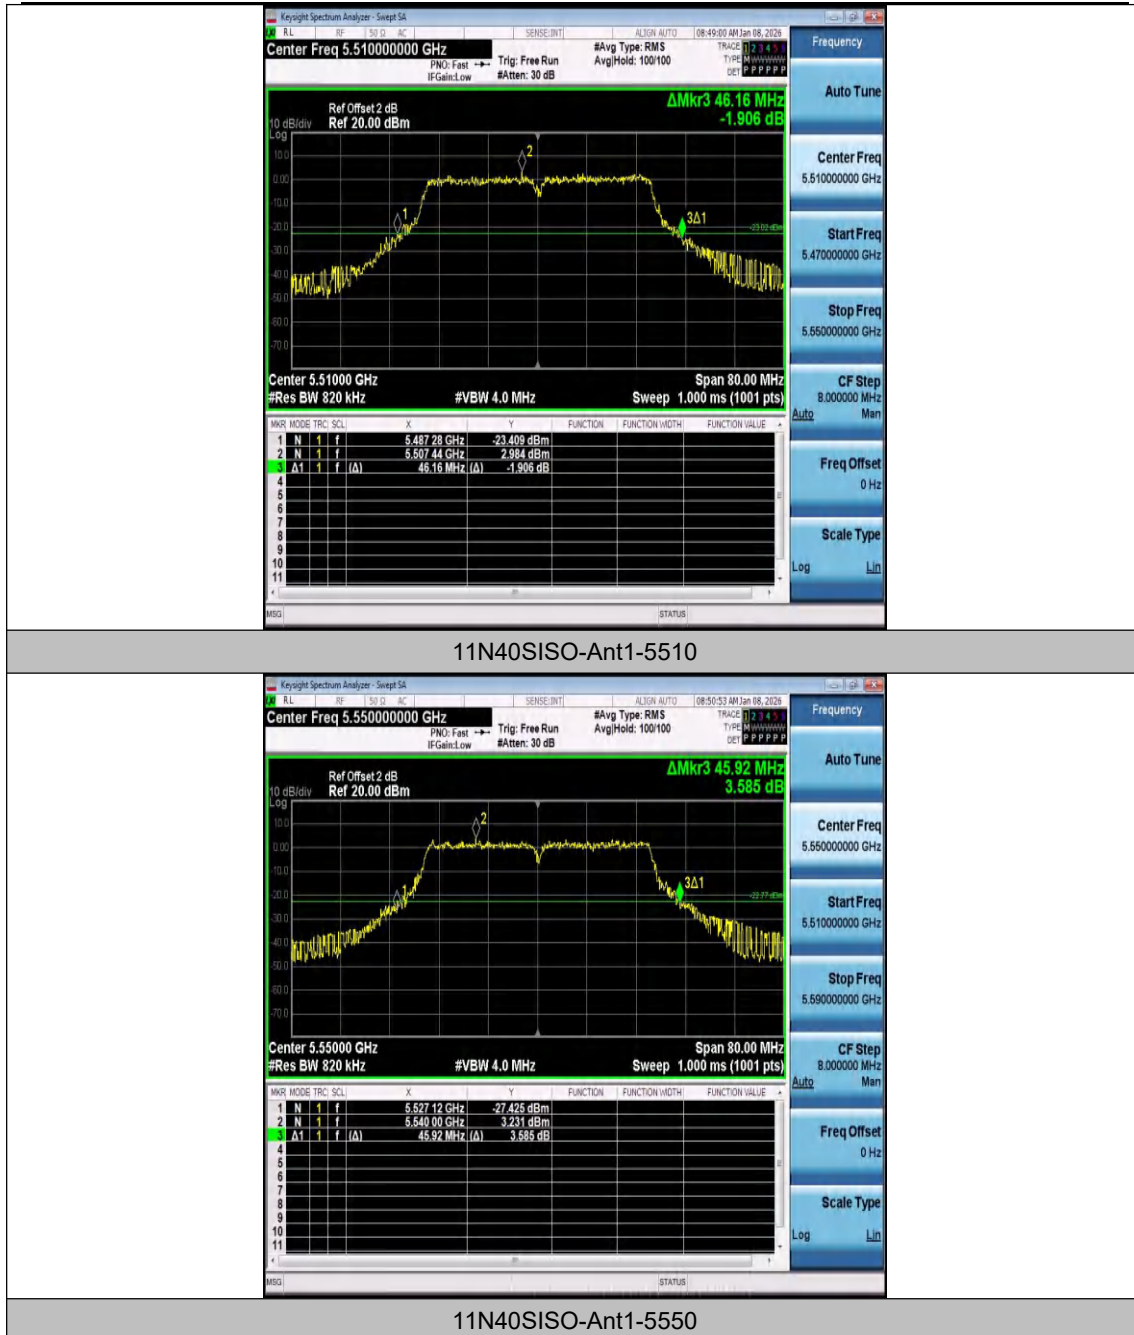

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

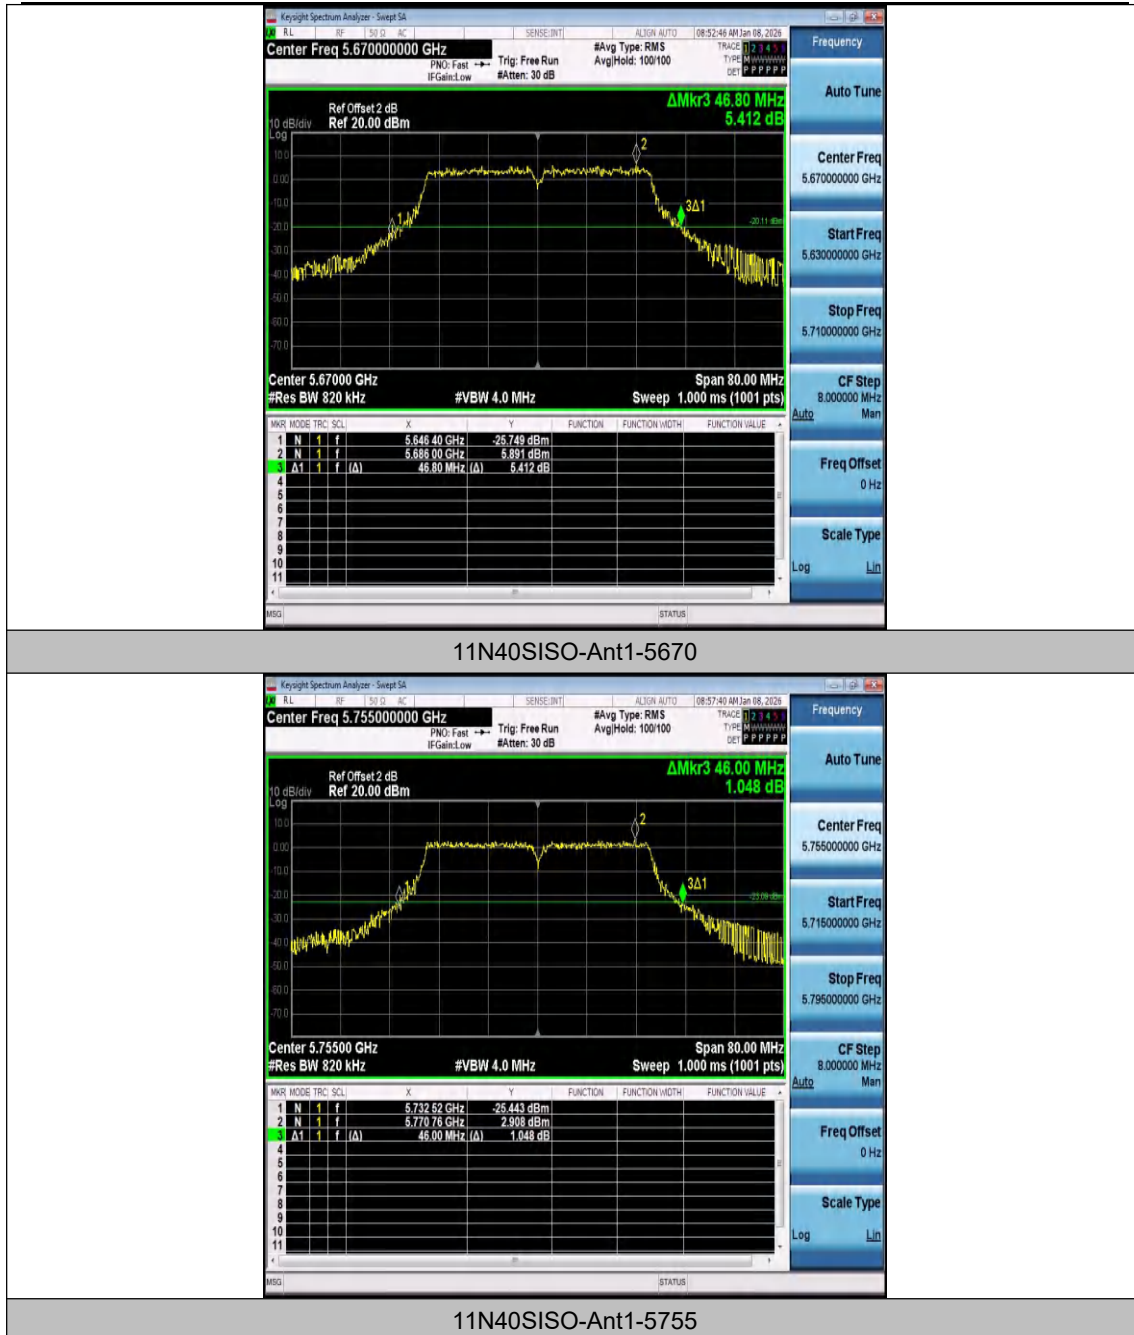


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

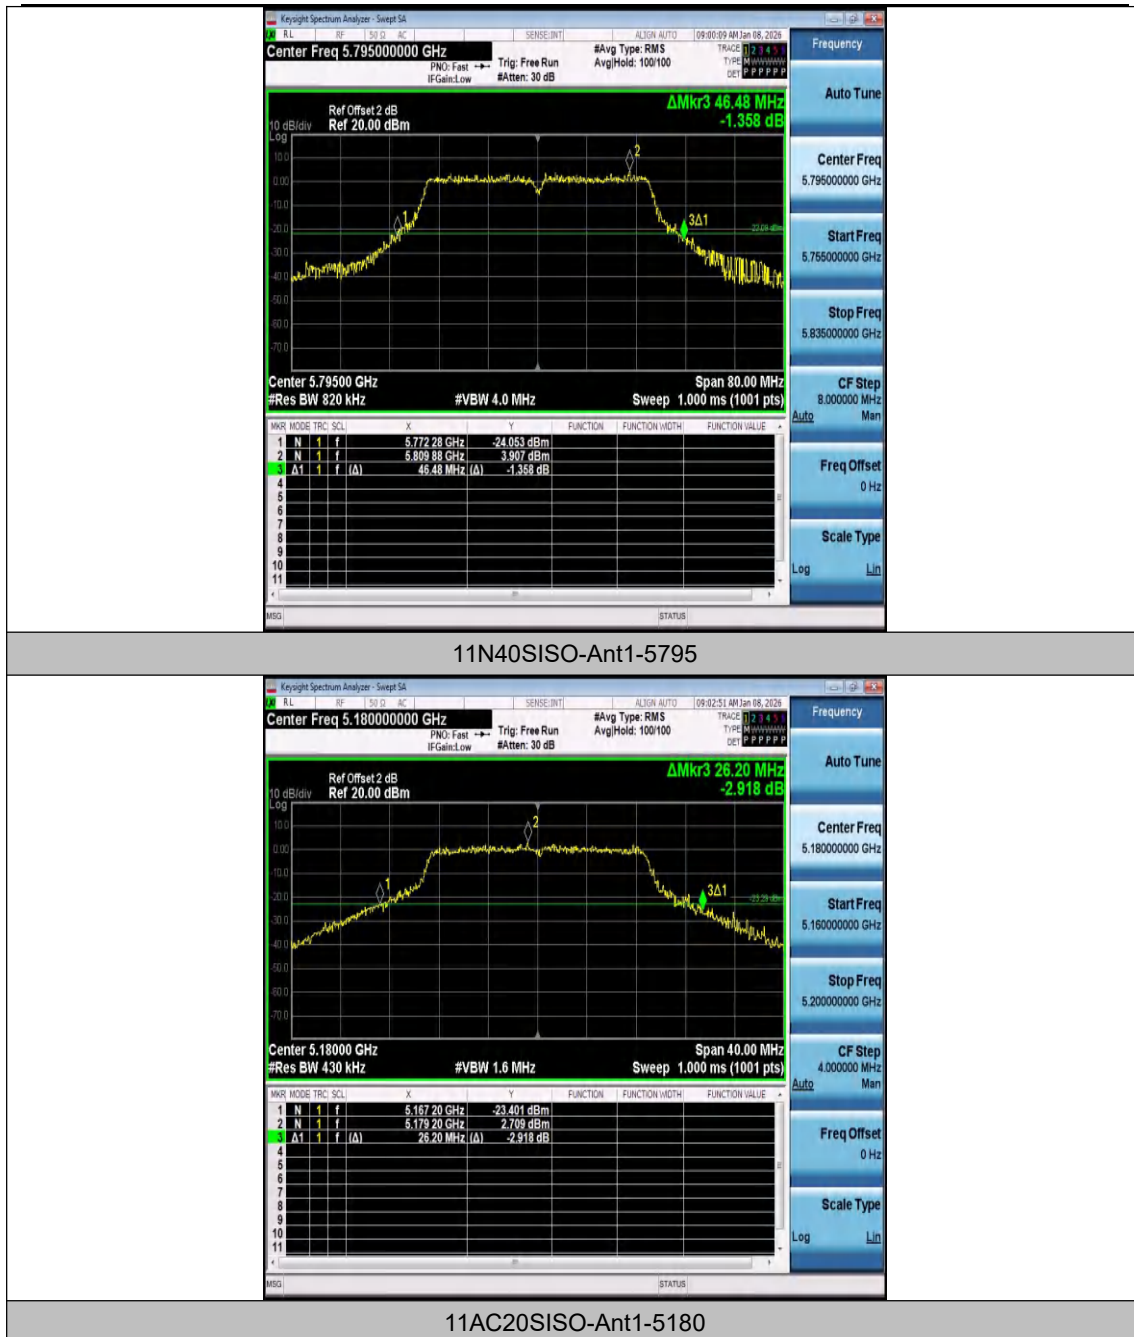


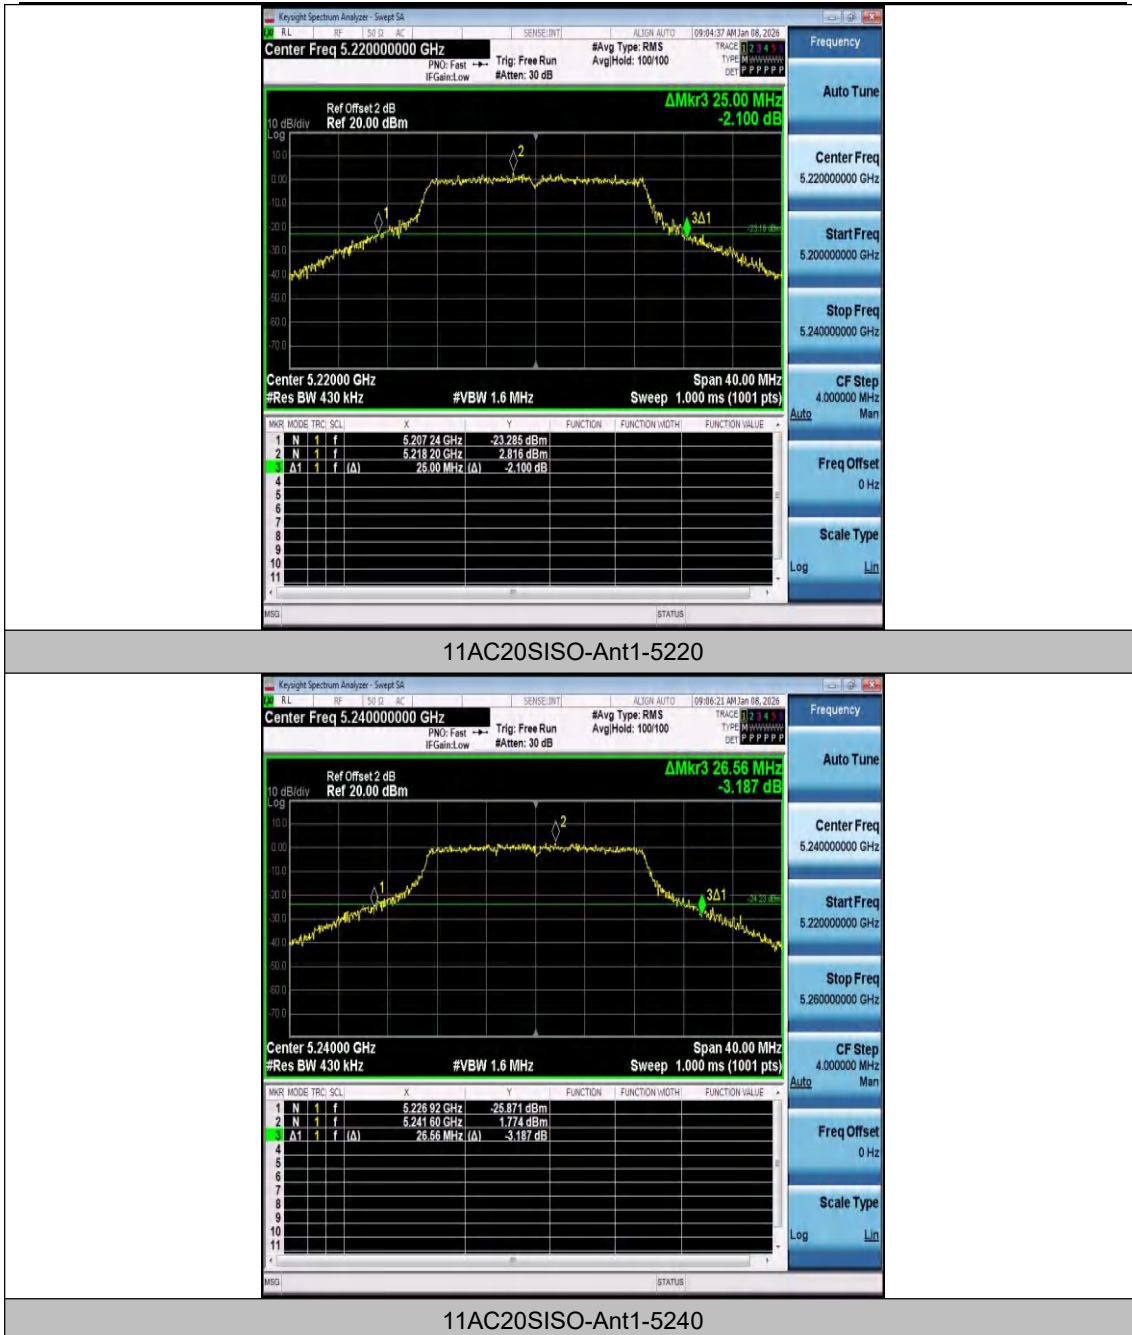


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

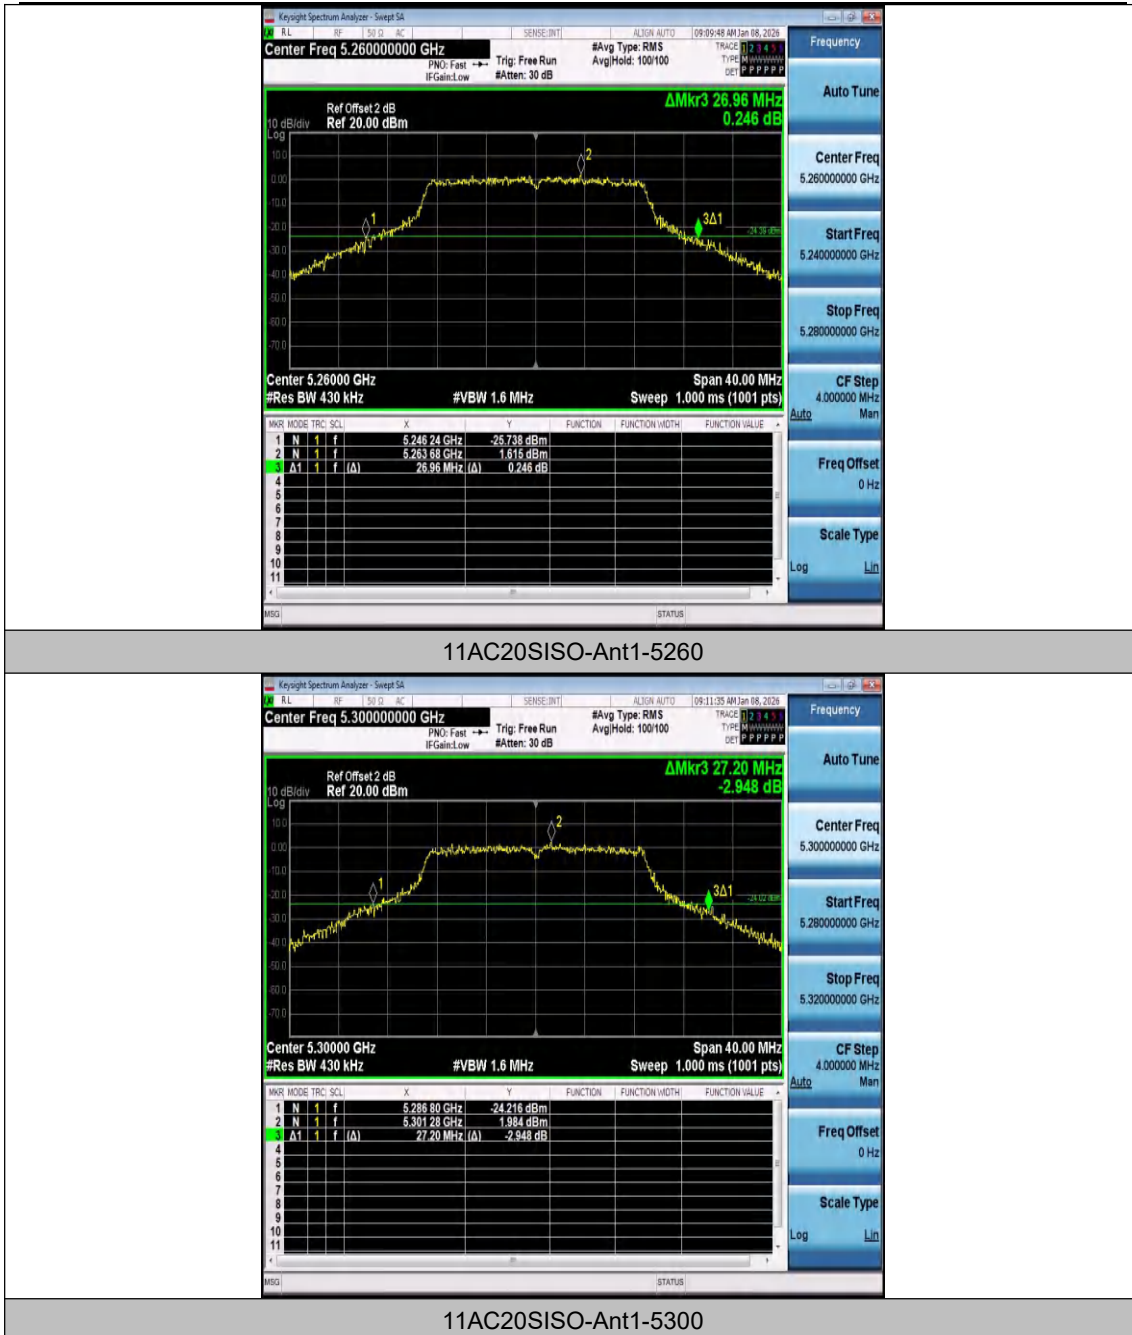


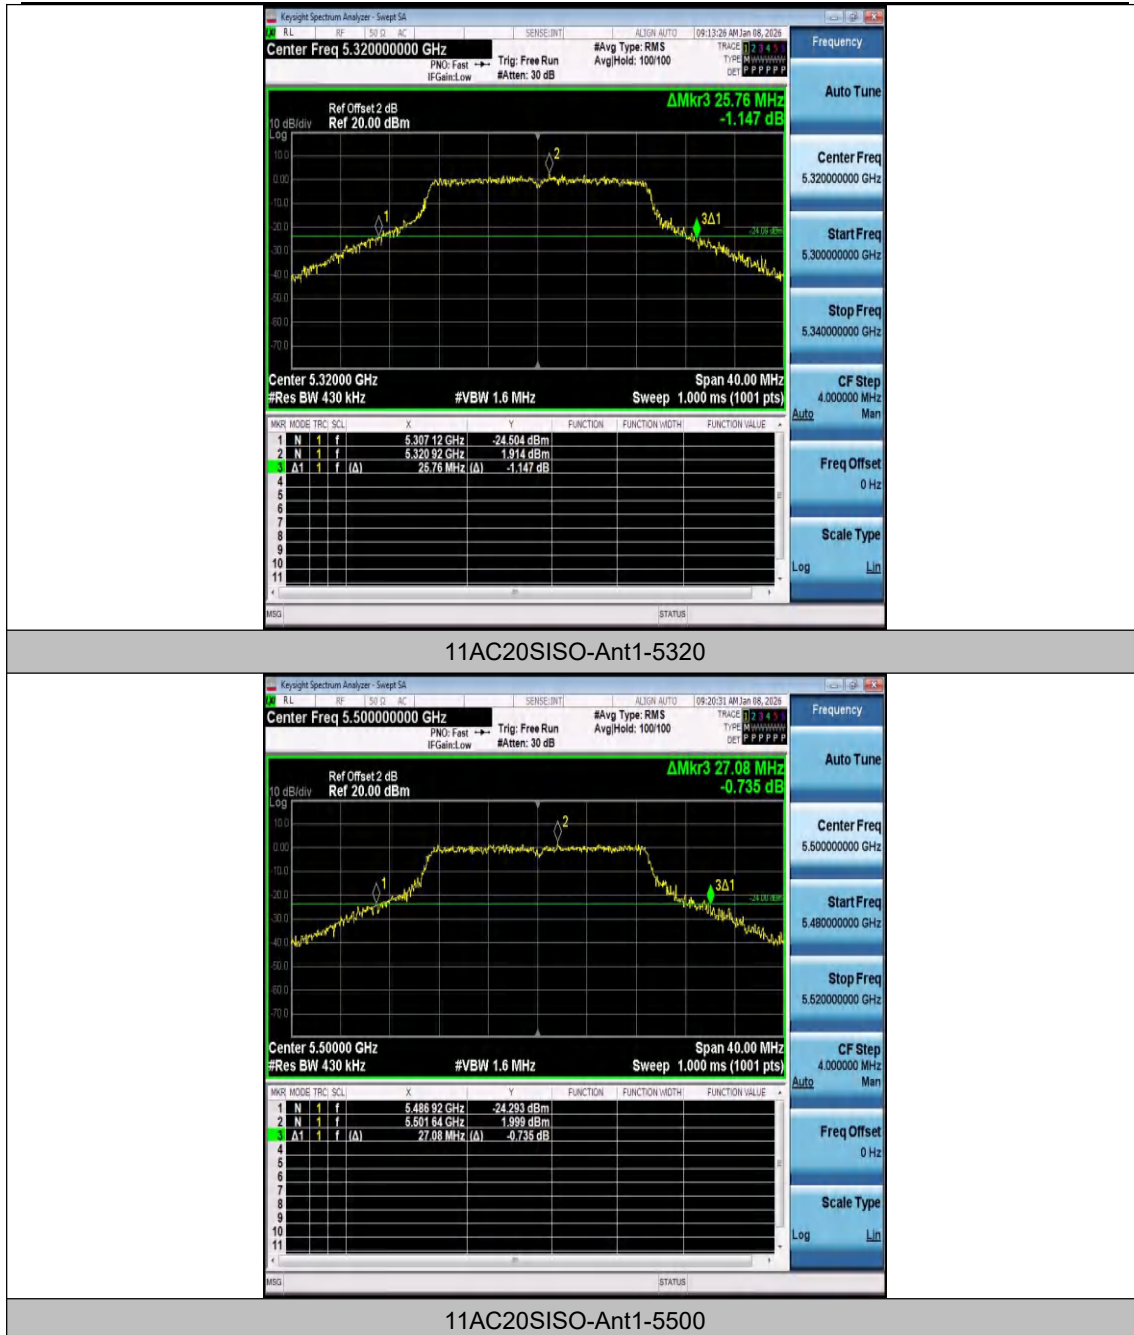

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

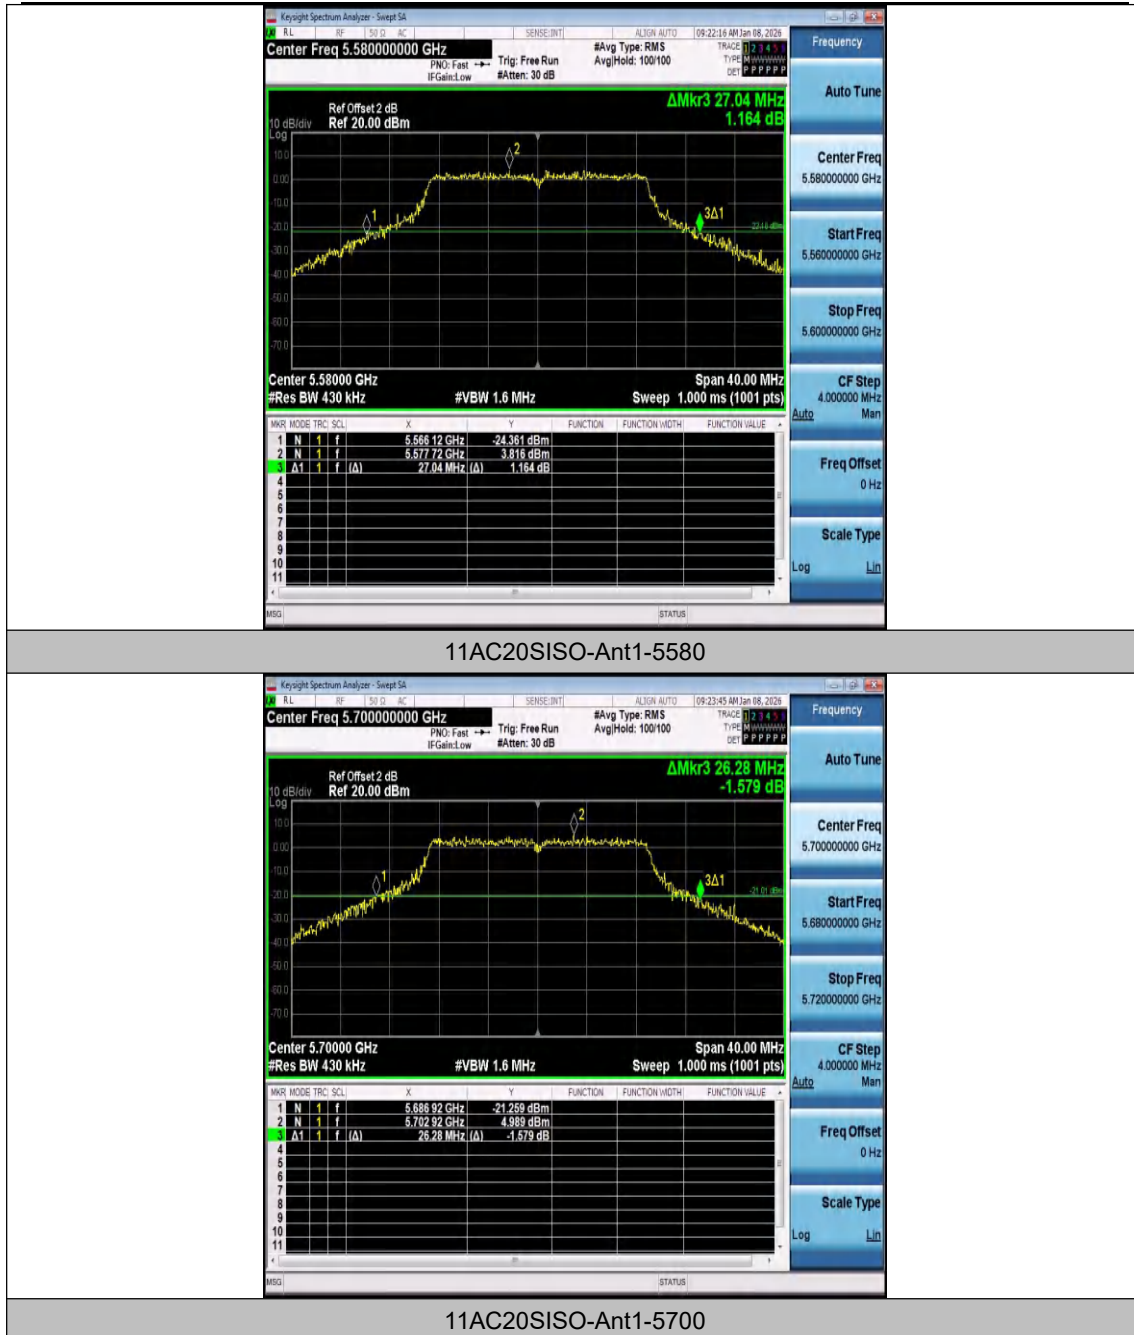

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

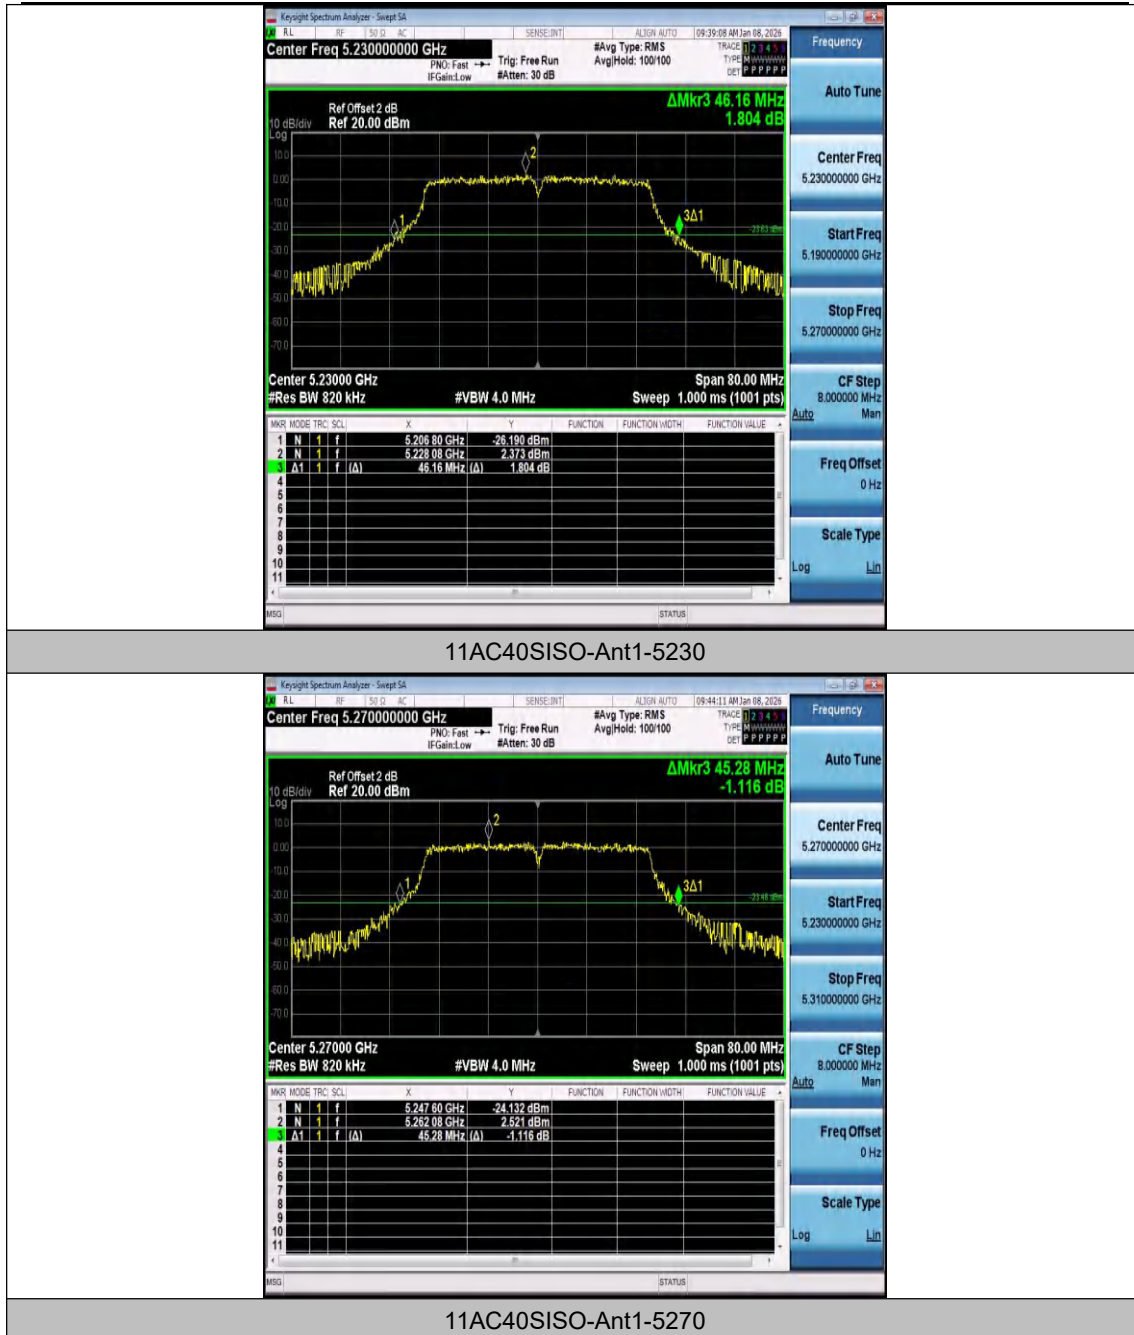


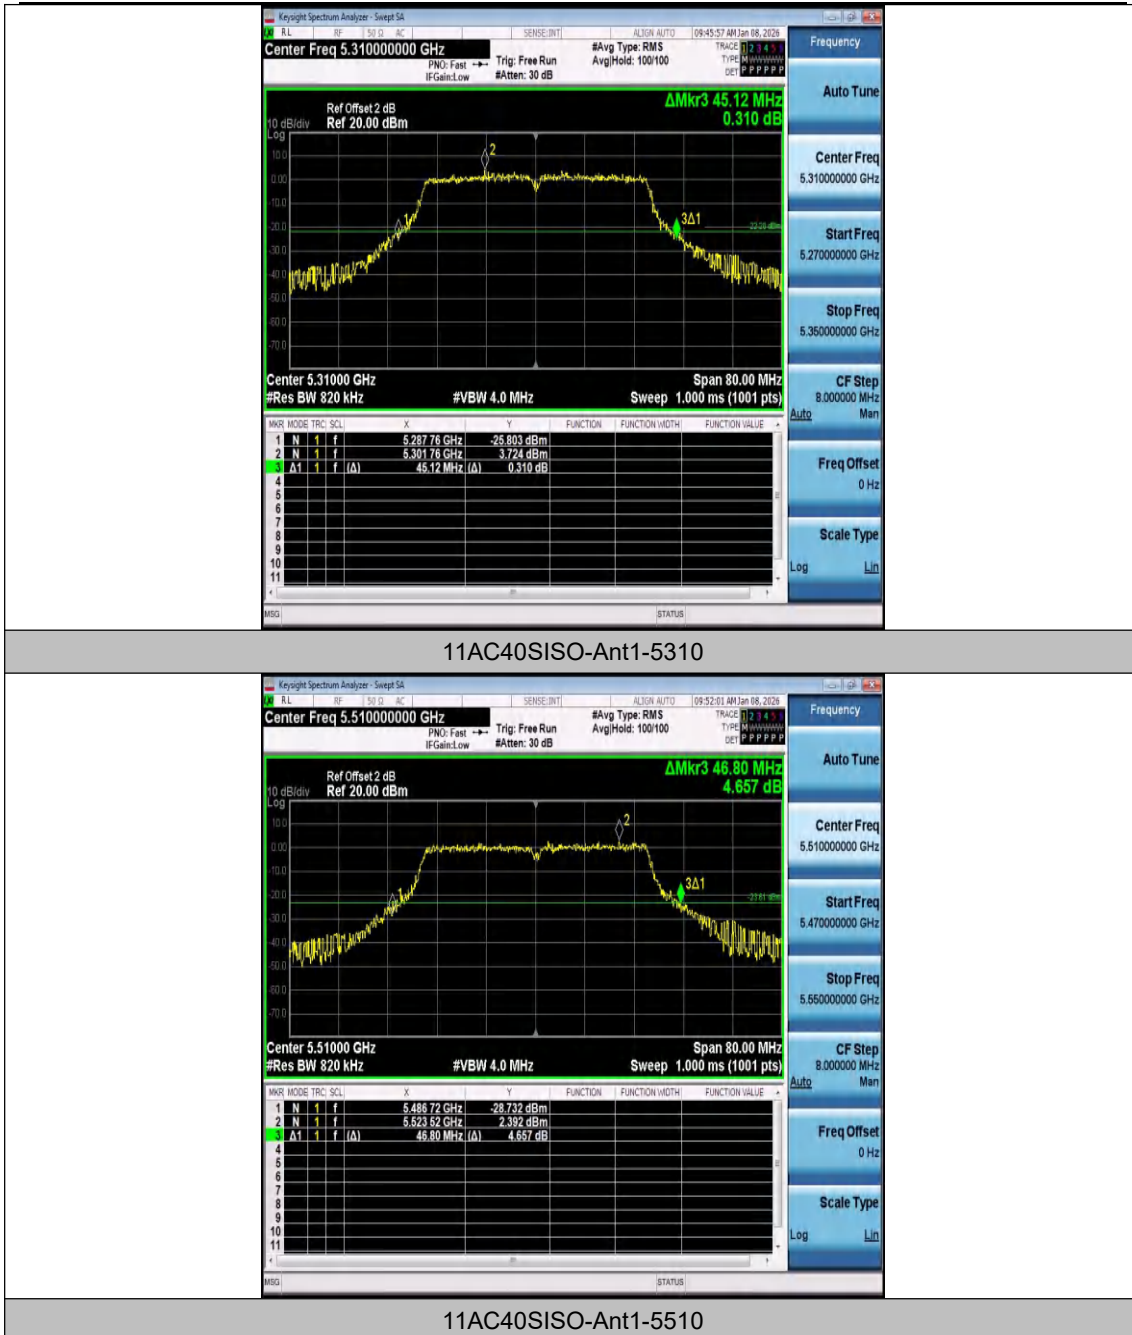


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

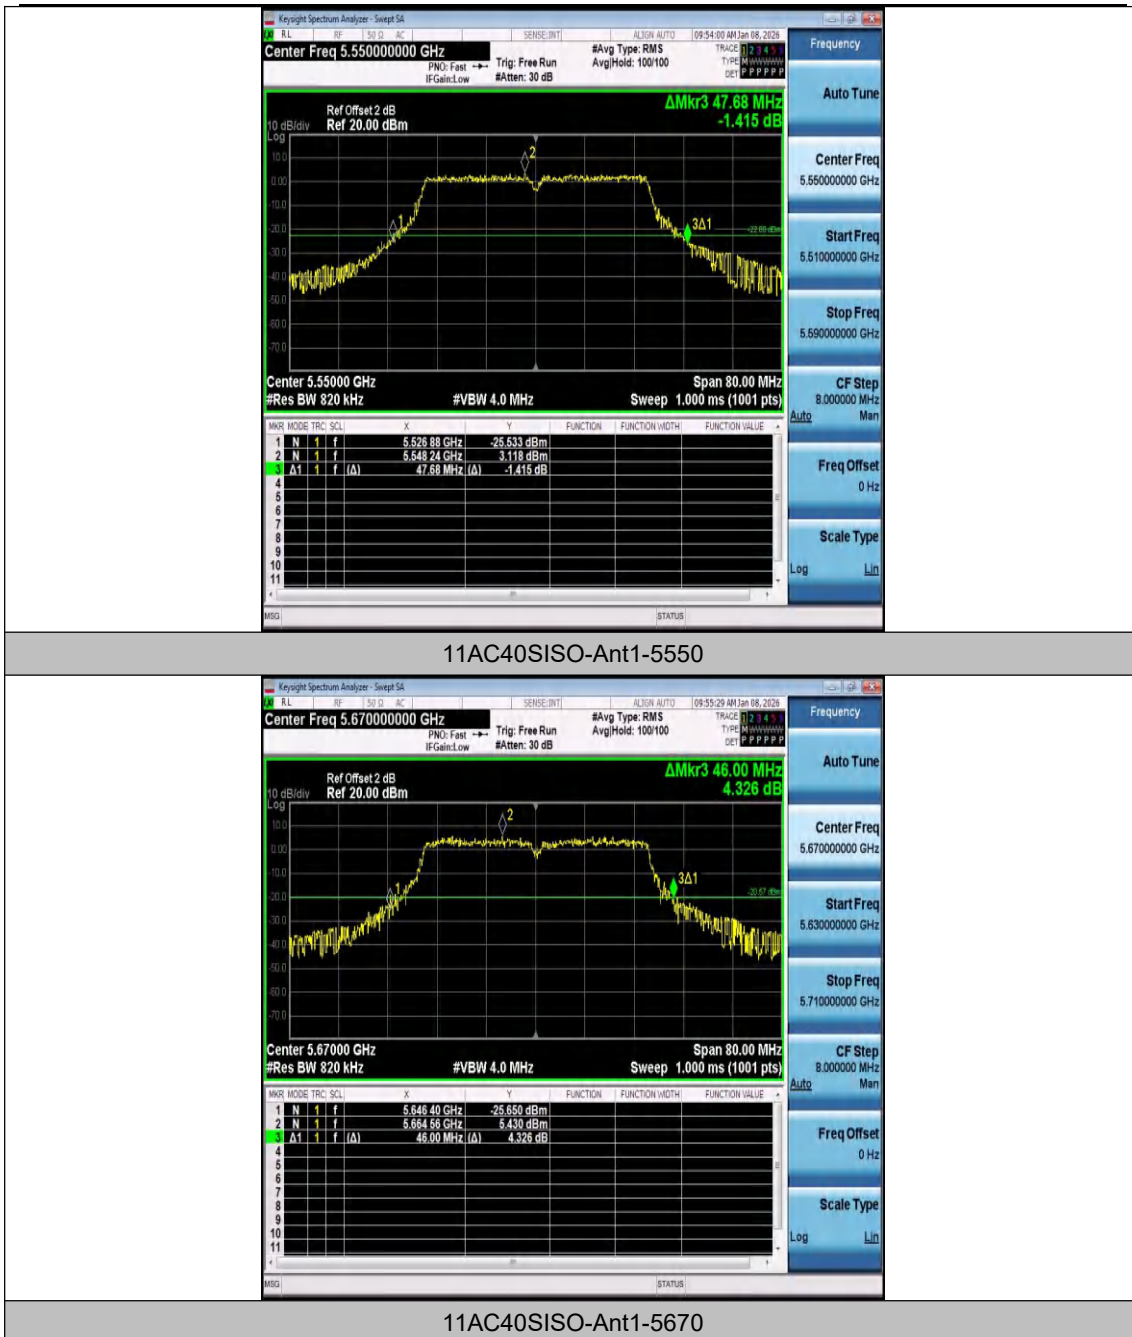



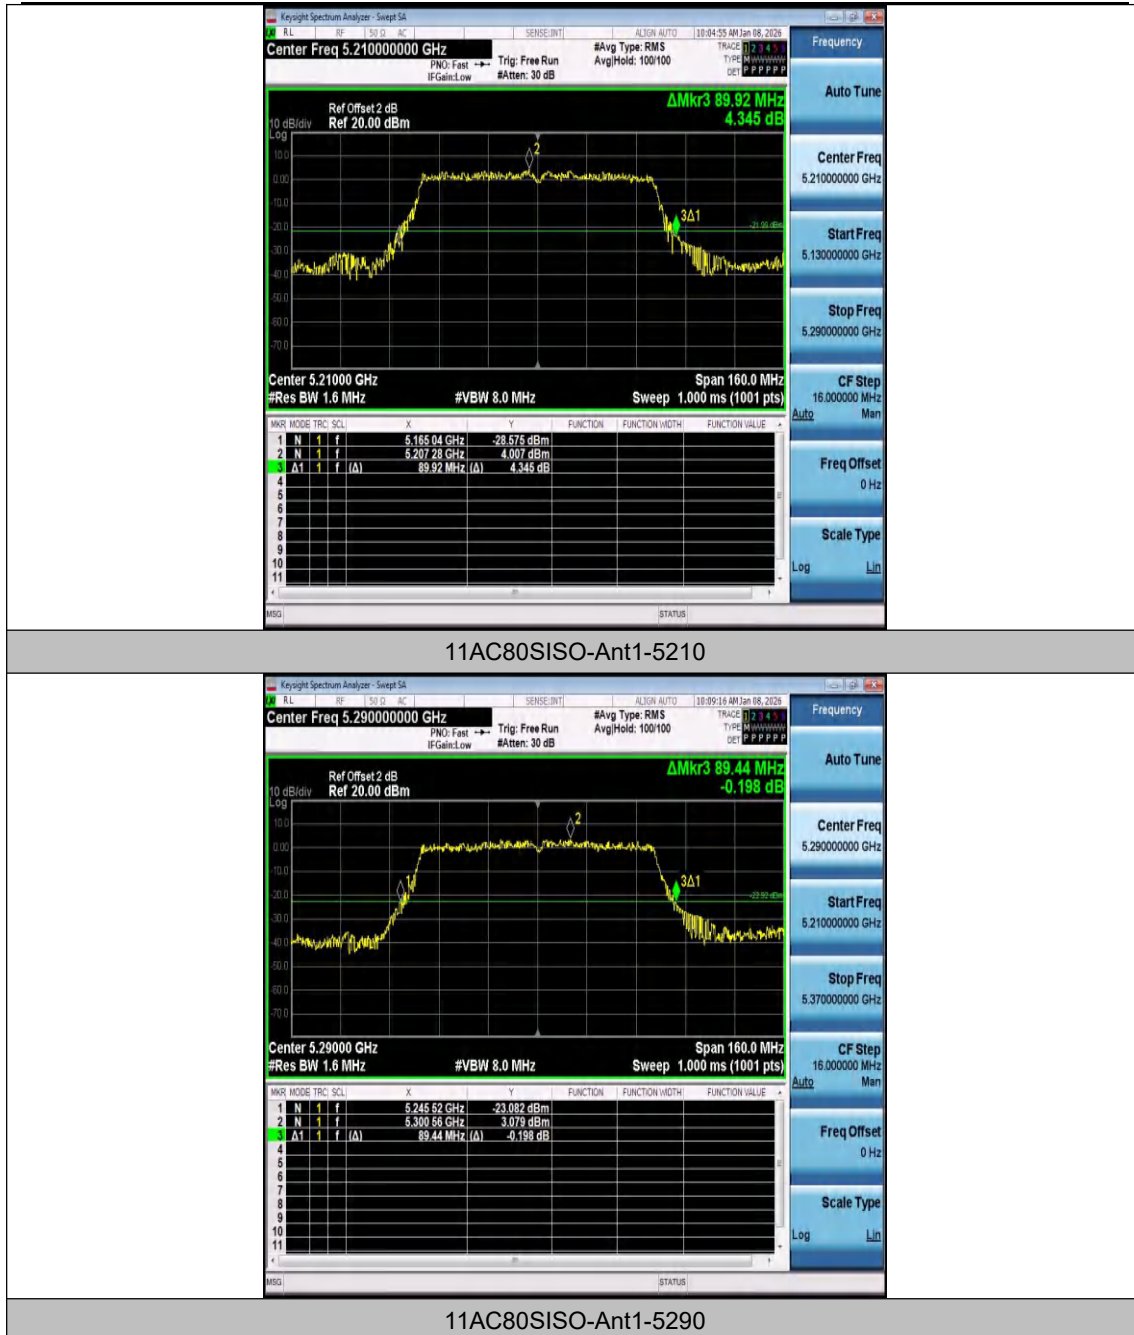


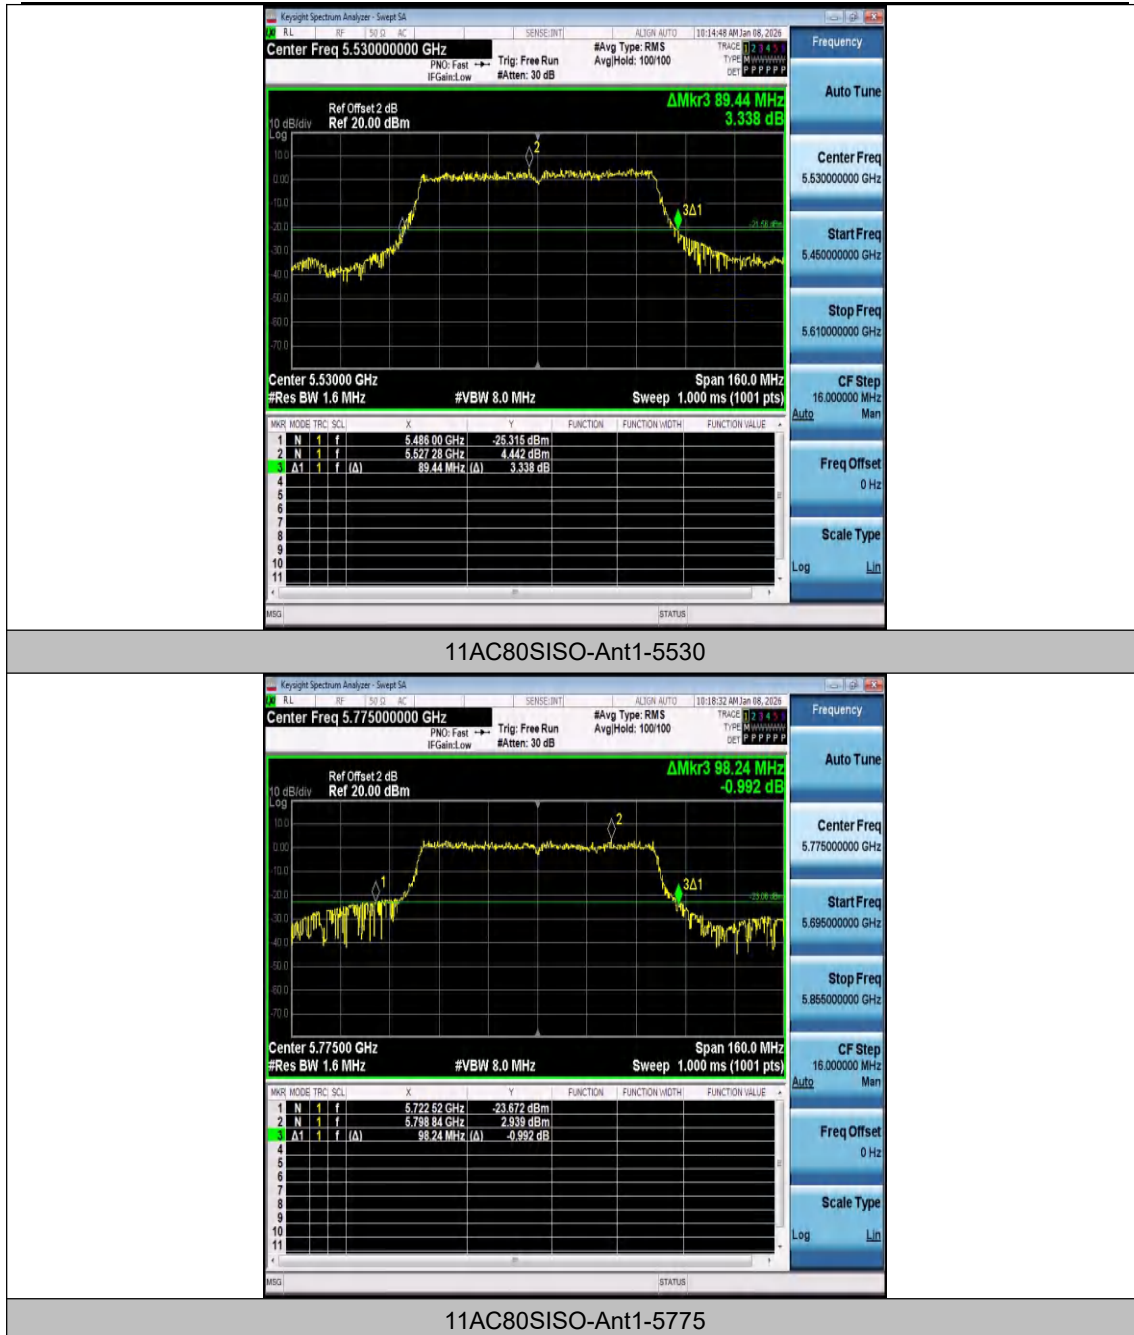


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

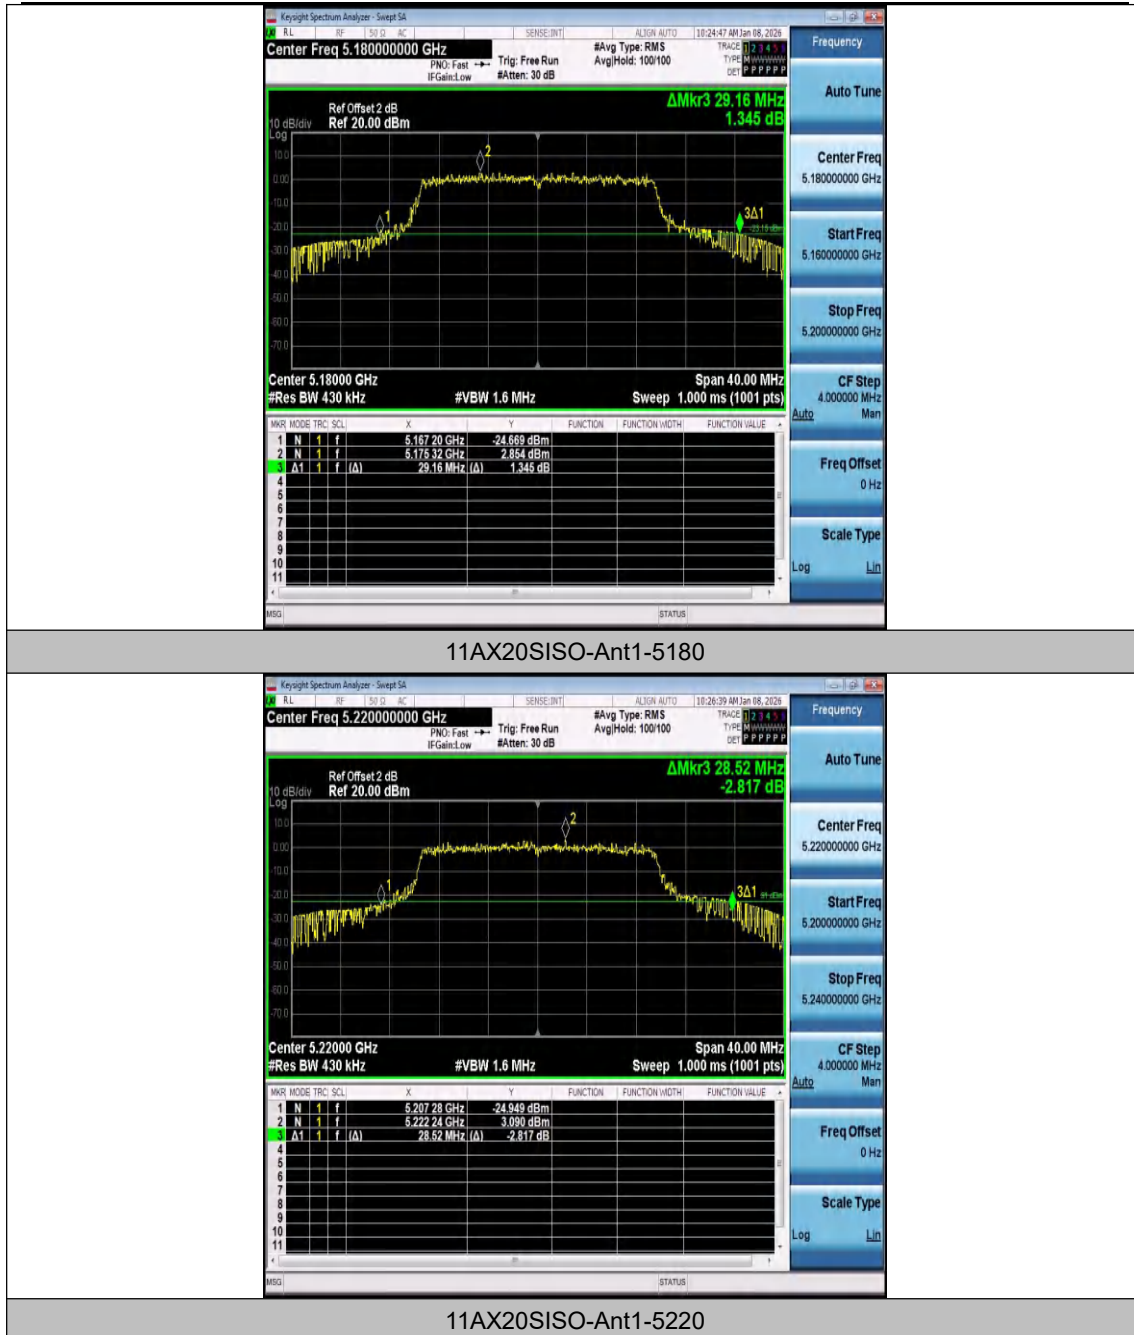


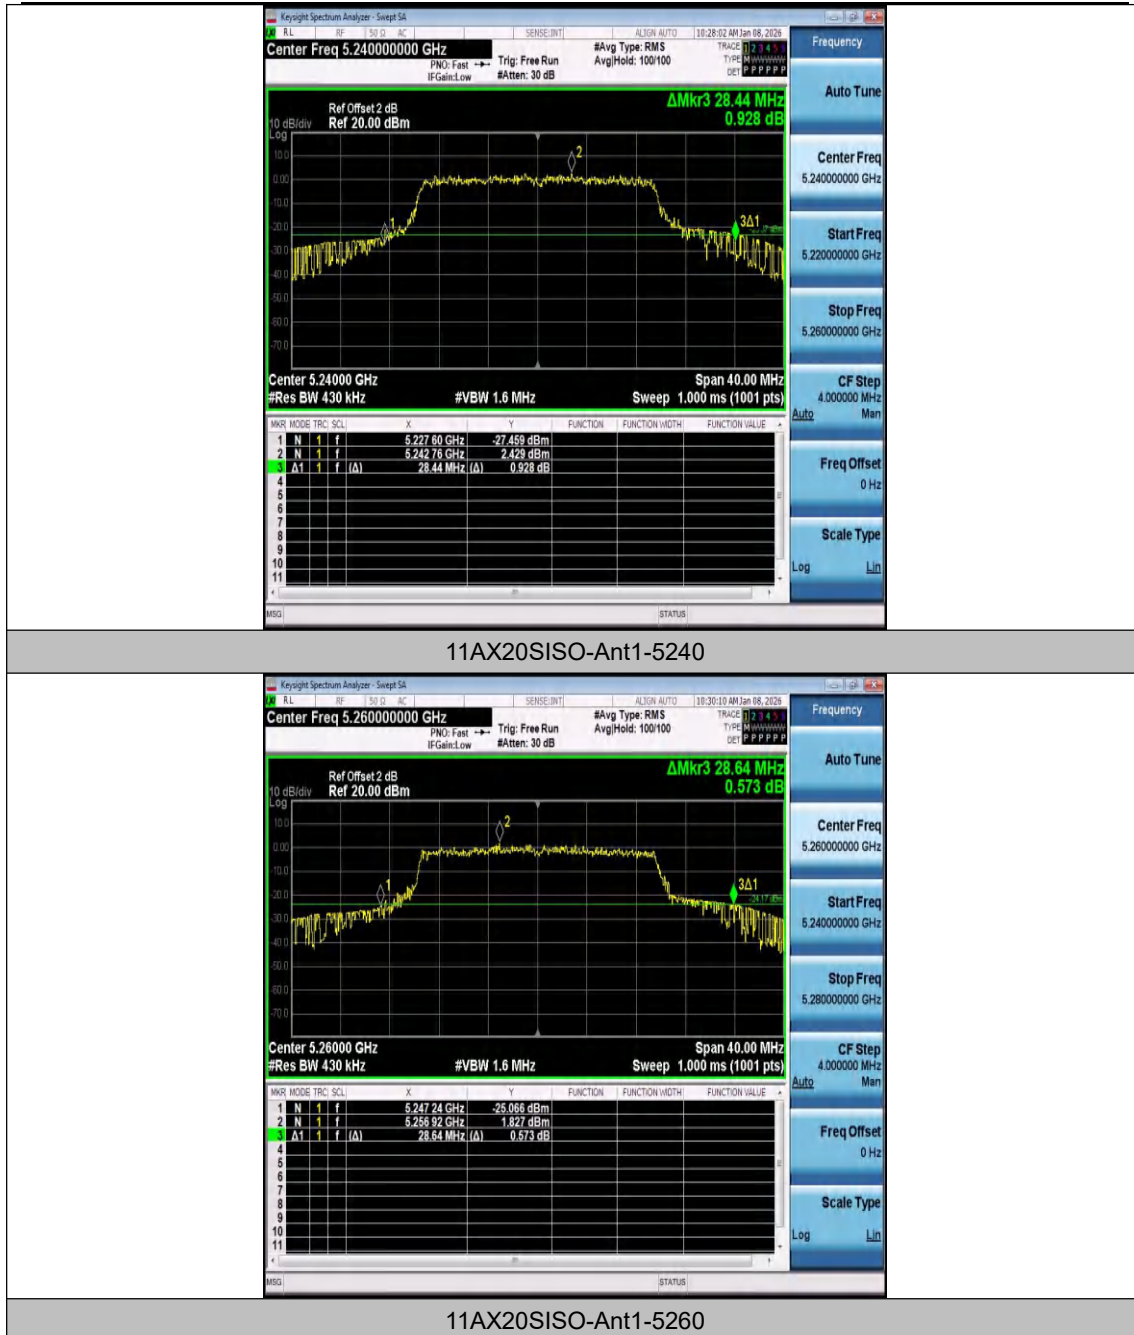

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

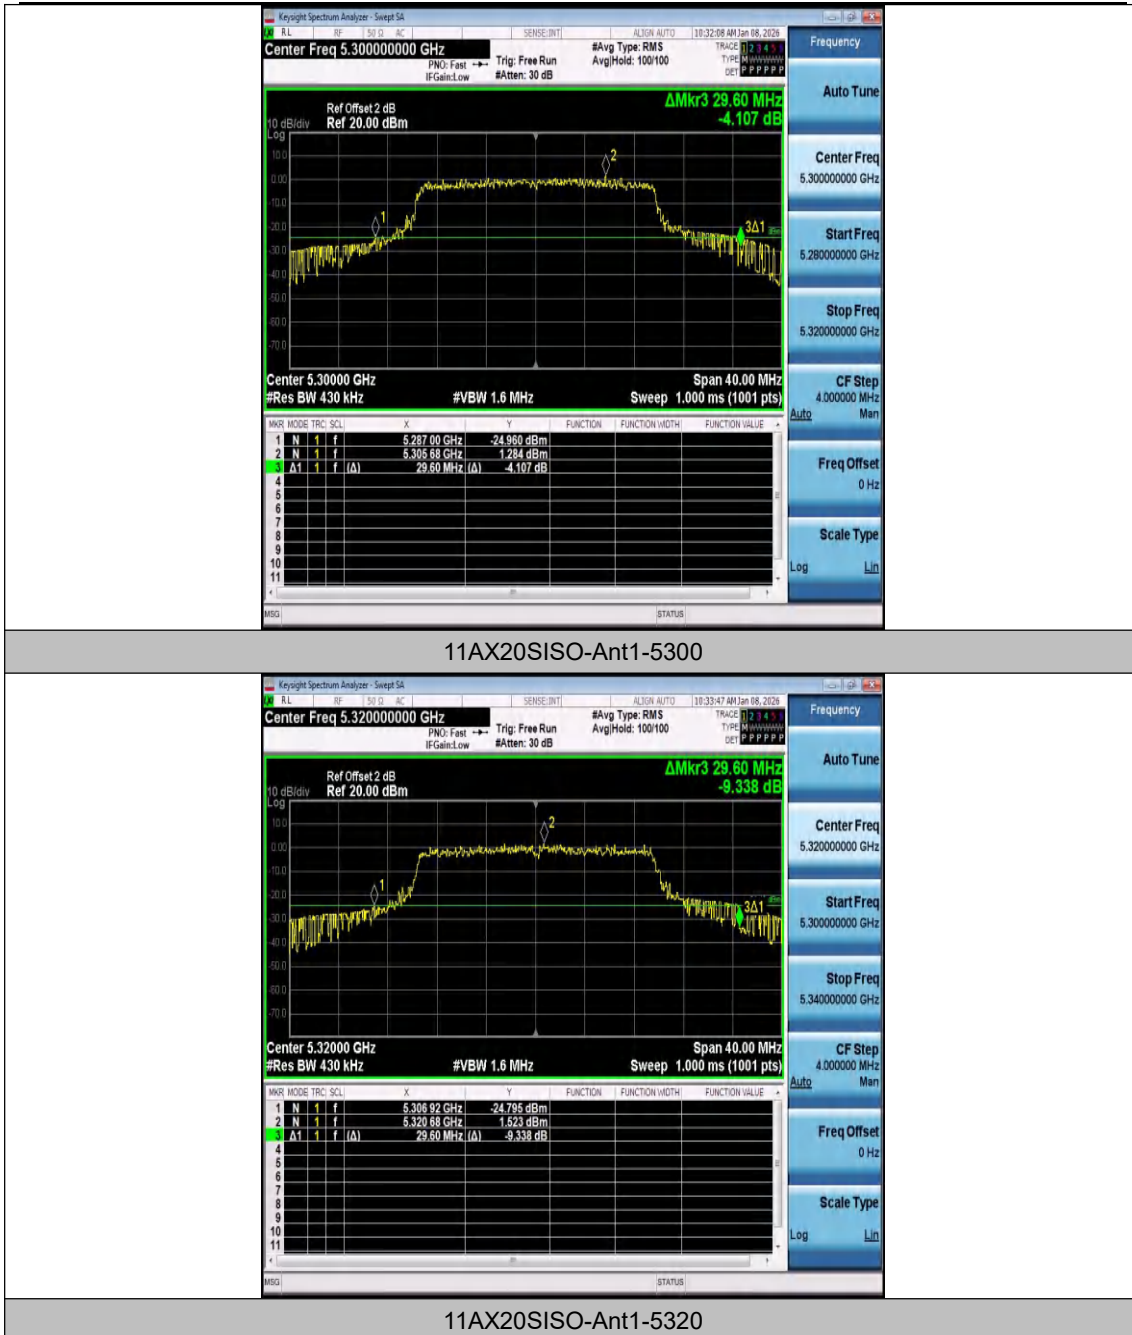

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

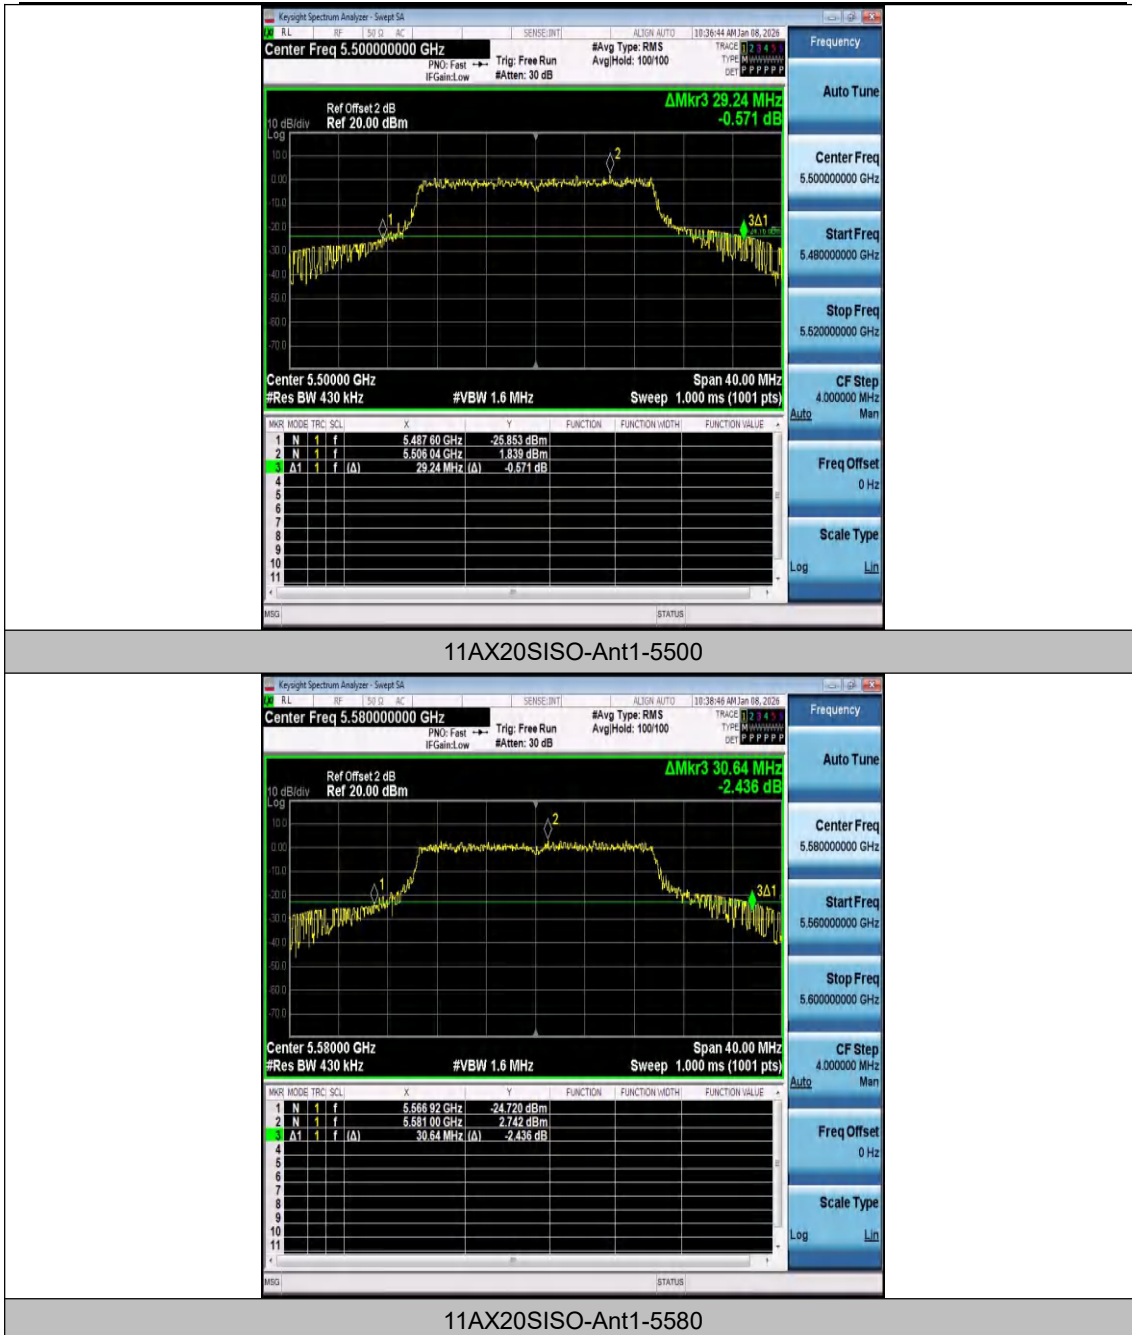


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

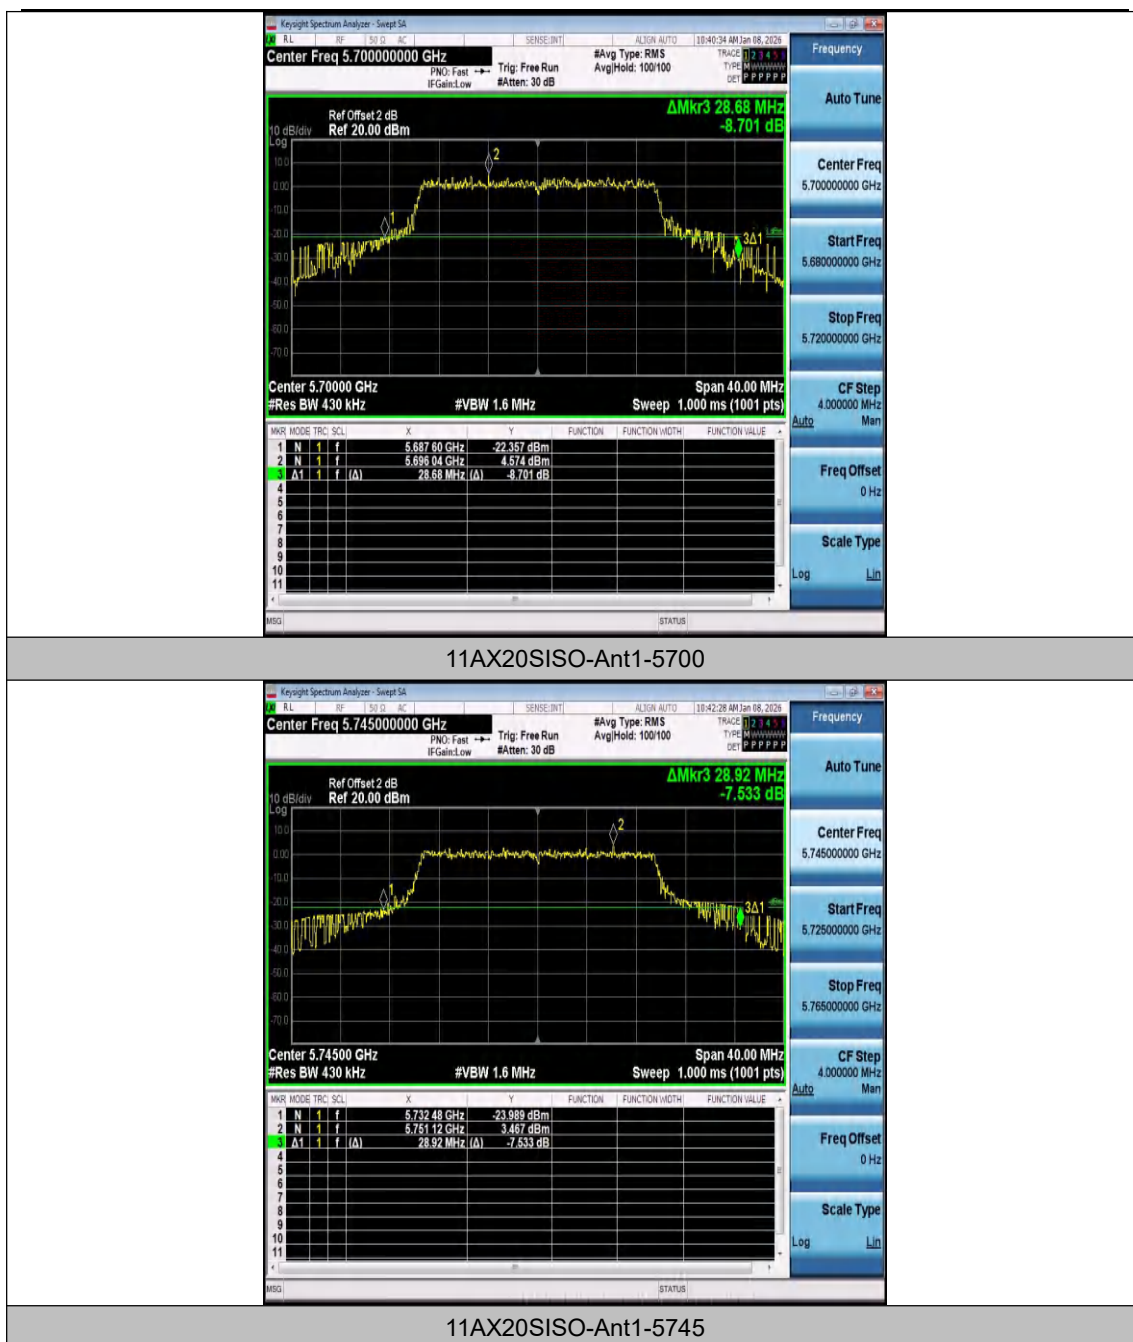


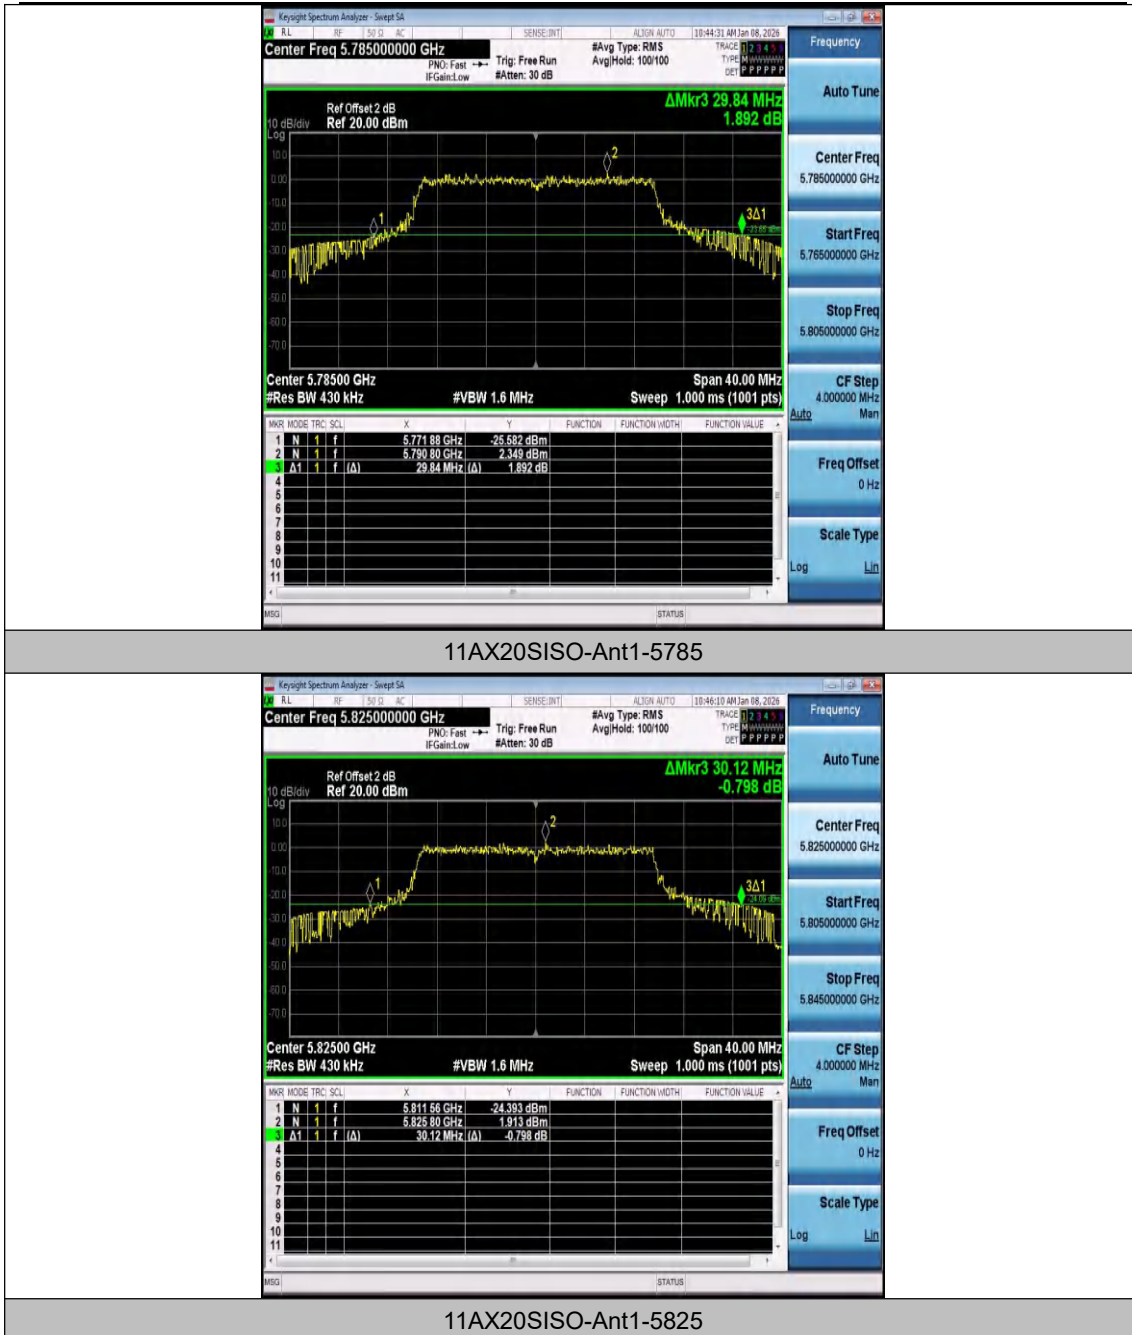



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

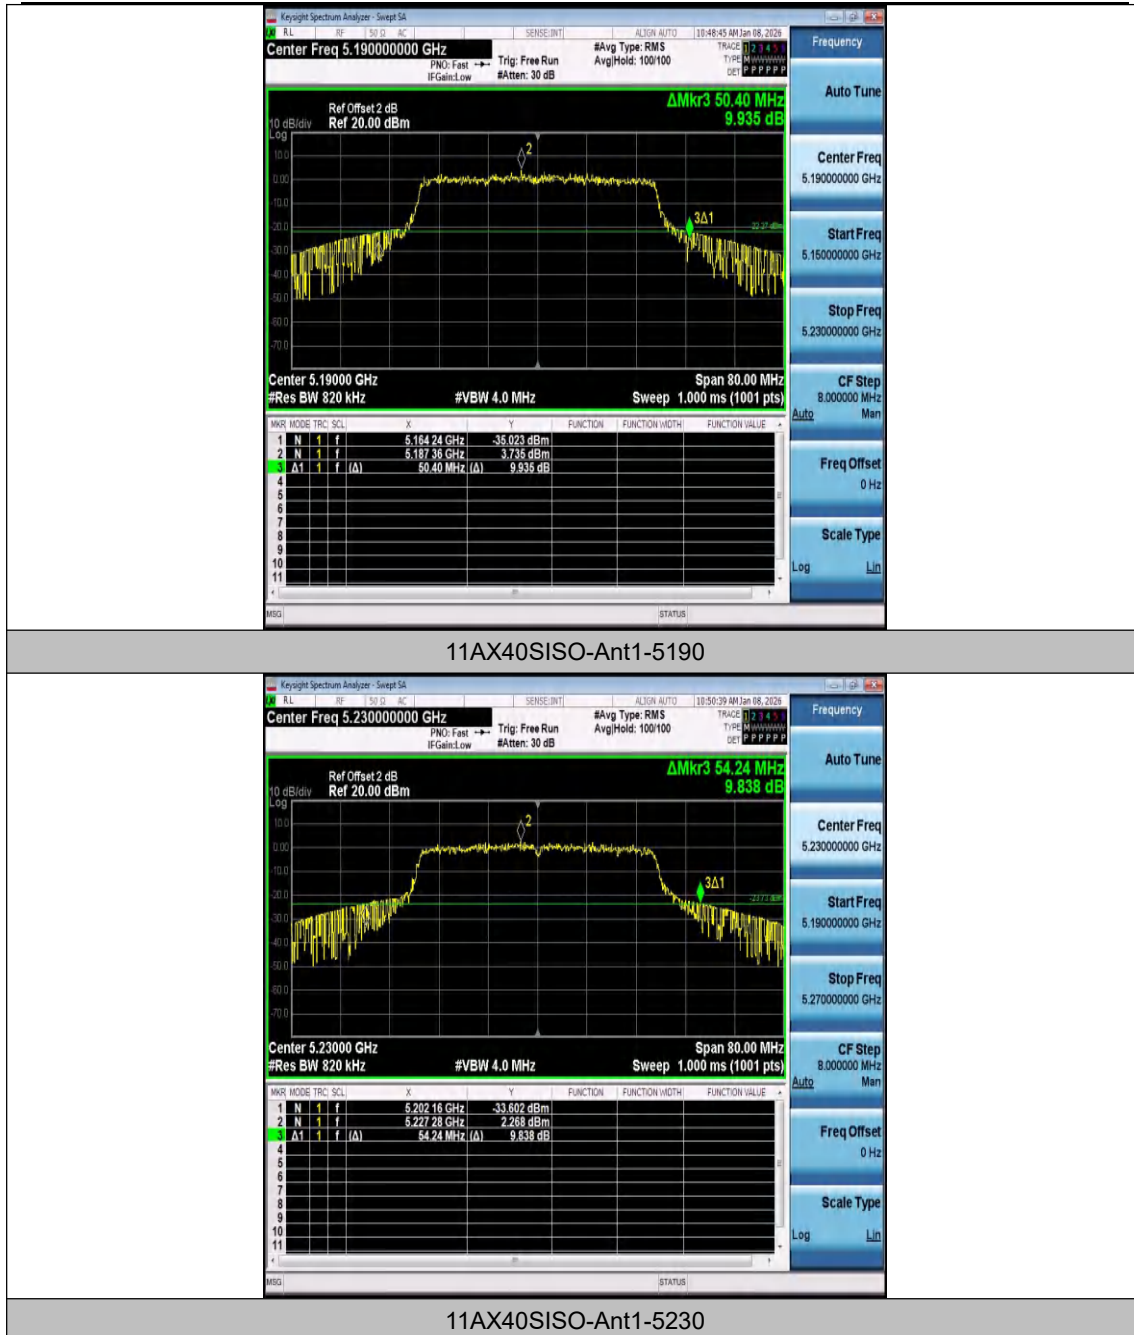


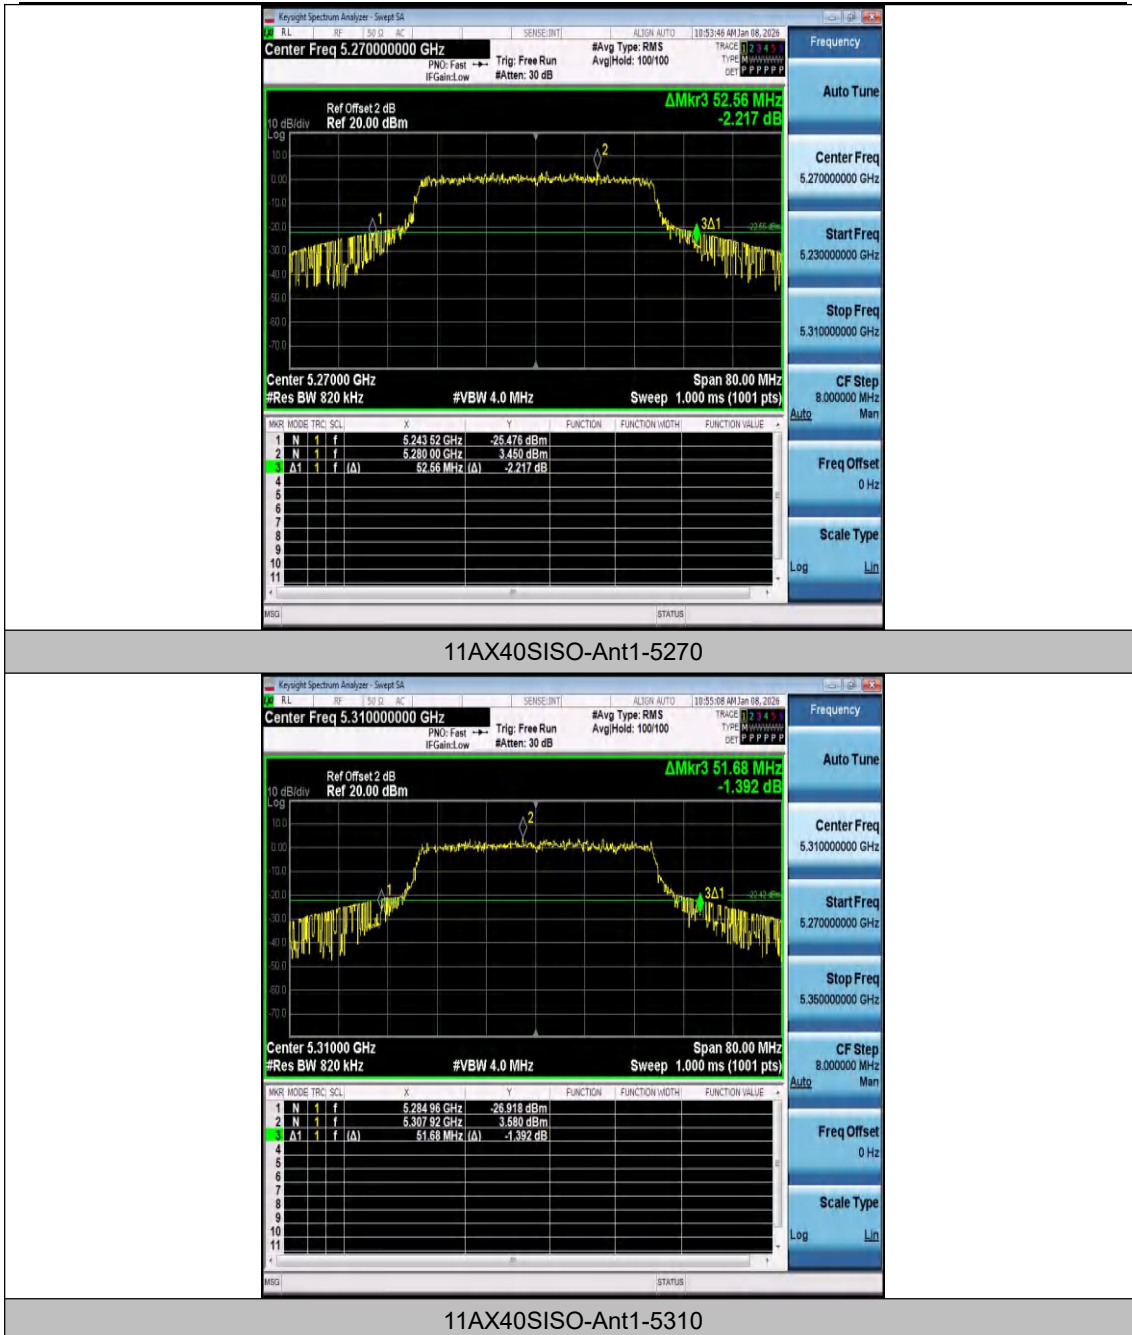

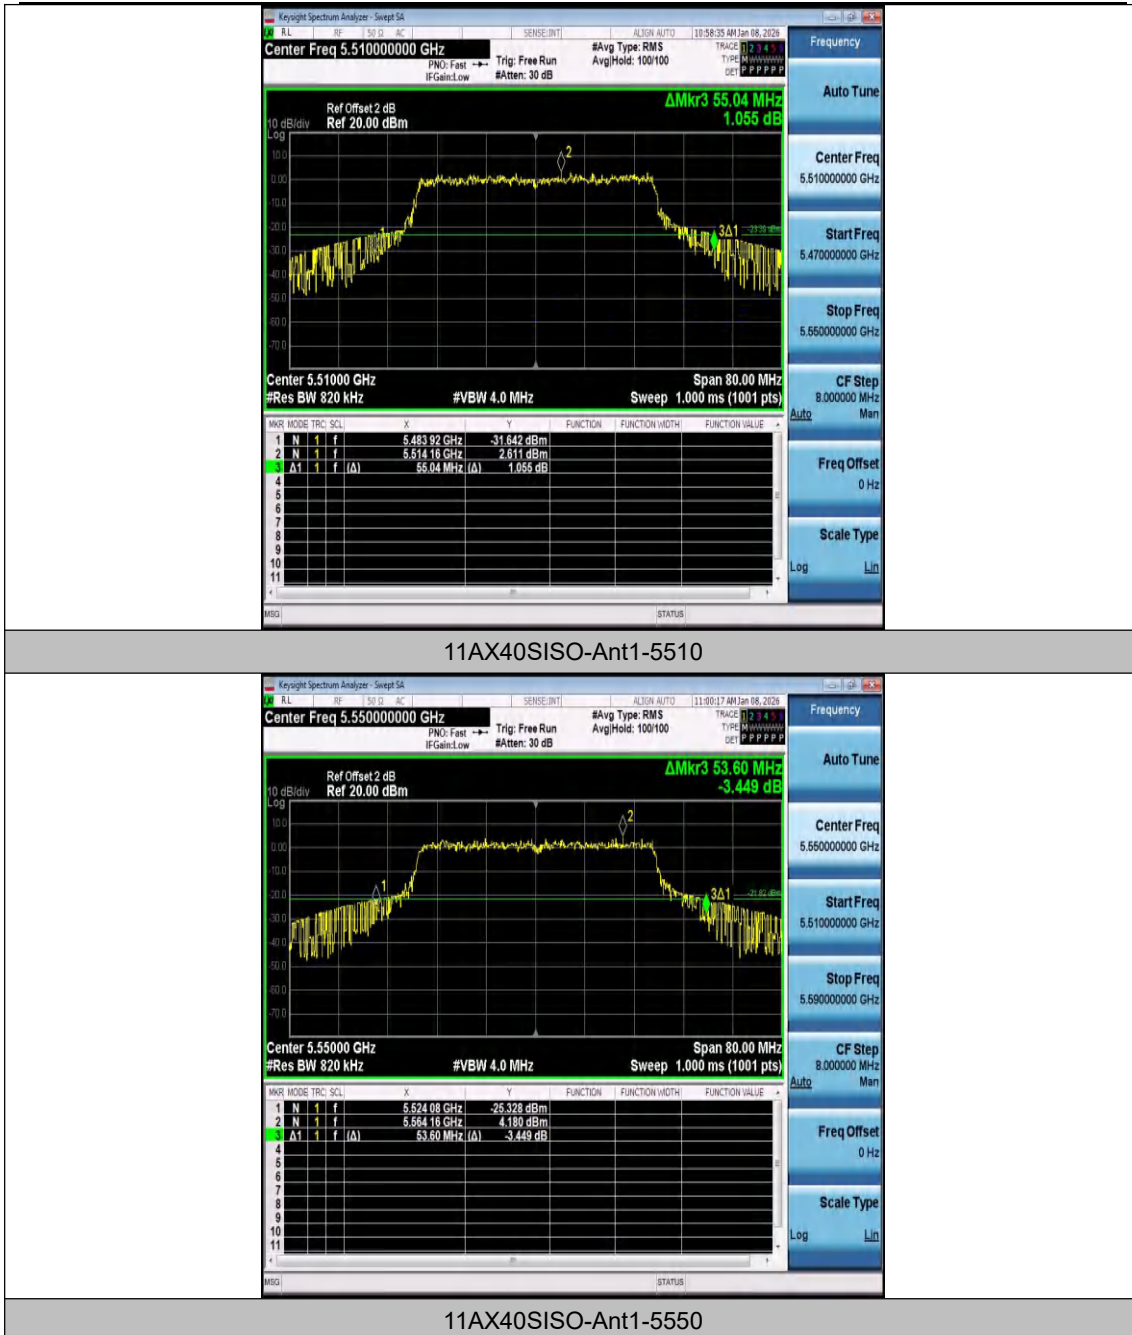

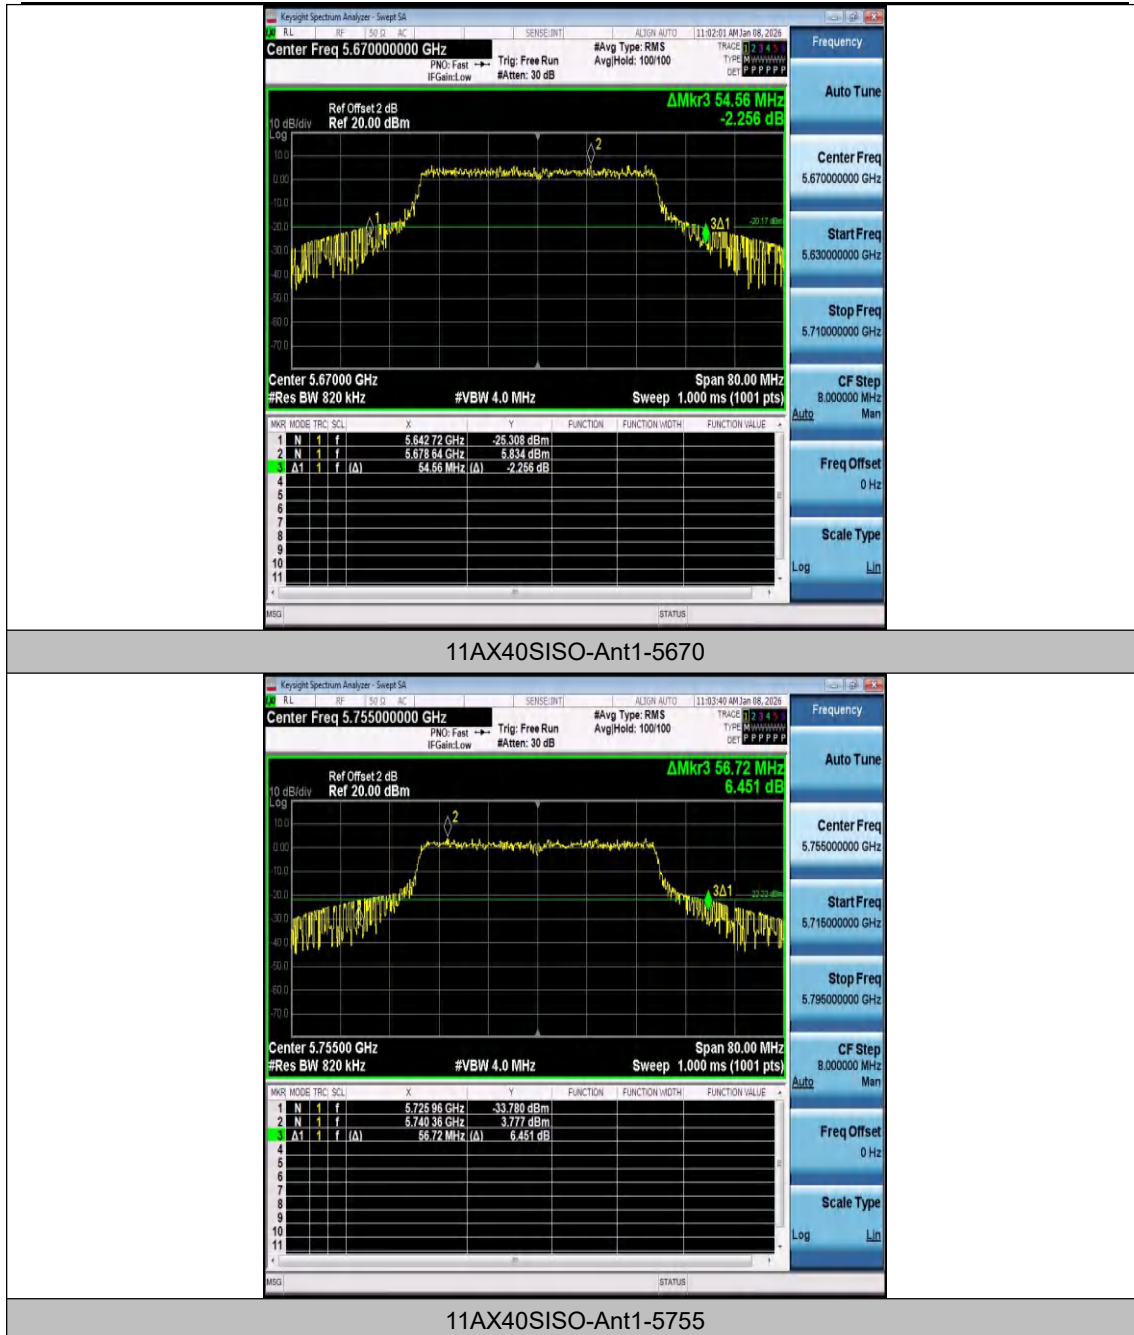

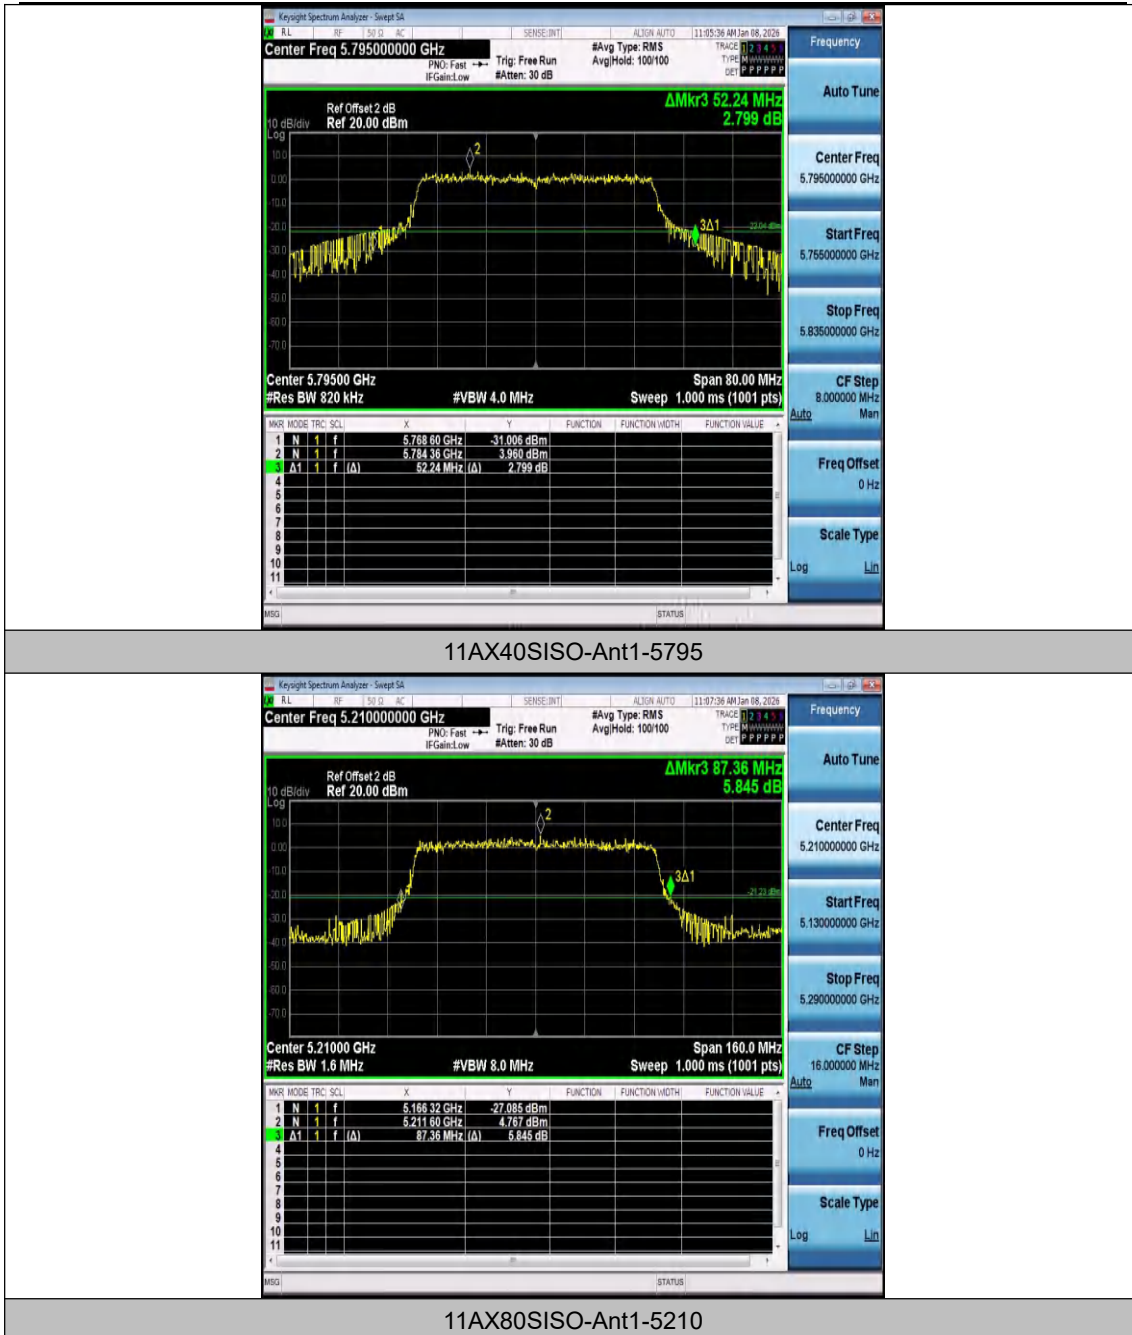


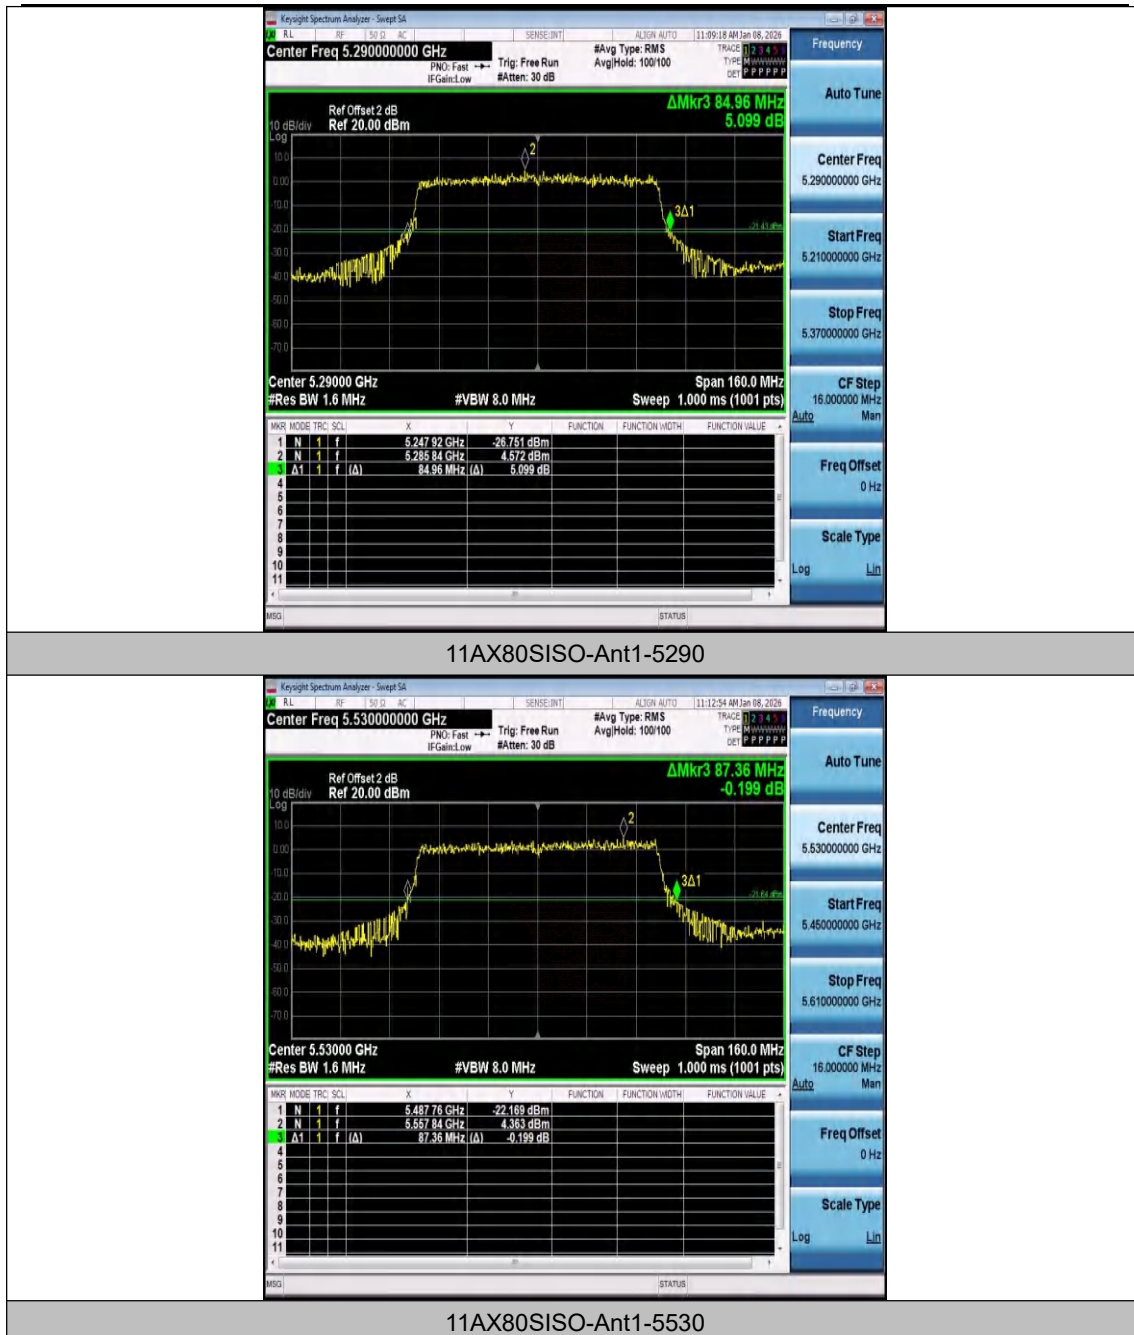

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

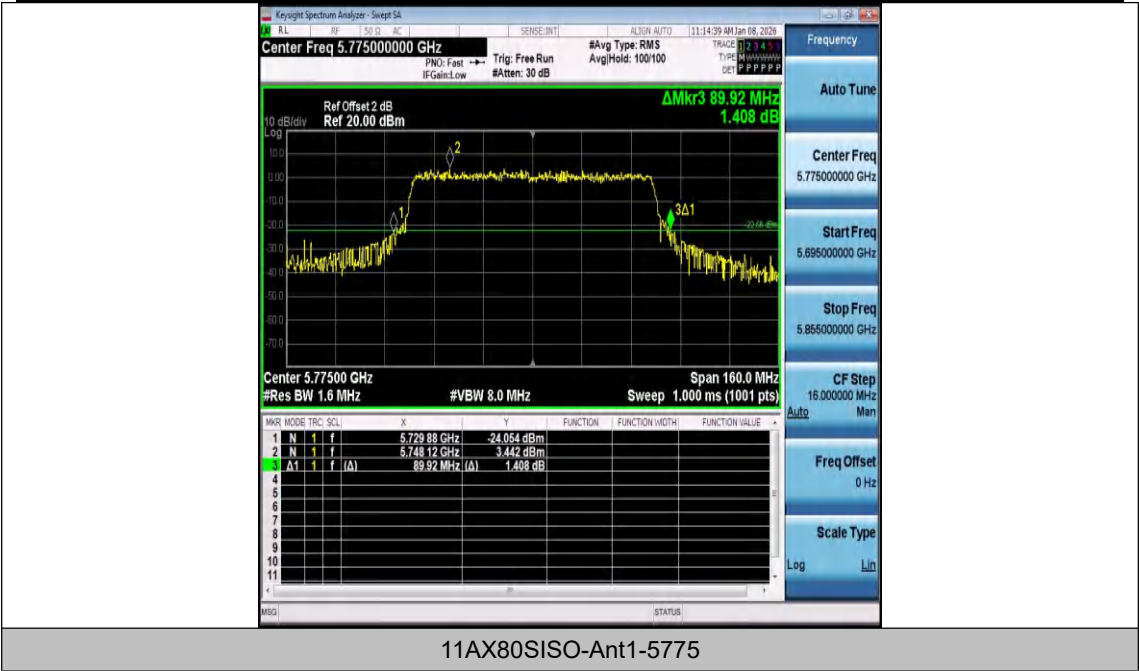

11AX80SISO-Ant1-5775

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	17.367	5171.3225	5188.6895	---	---
11A	Ant1	5220	17.423	5211.3203	5228.7433	---	---
11A	Ant1	5240	17.426	5231.3020	5248.7280	---	---
11A	Ant1	5260	17.424	5251.3014	5268.7254	---	---
11A	Ant1	5300	17.417	5291.3788	5308.7958	---	---
11A	Ant1	5320	17.391	5311.3401	5328.7311	---	---
11A	Ant1	5500	17.725	5491.2930	5509.0180	---	---
11A	Ant1	5580	17.749	5571.1790	5588.9280	---	---
11A	Ant1	5700	17.610	5691.2014	5708.8114	---	---
11A	Ant1	5745	17.628	5736.2193	5753.8473	---	---
11A	Ant1	5785	17.729	5776.1888	5793.9178	---	---
11A	Ant1	5825	17.599	5816.1878	5833.7868	---	---
11N20SISO	Ant1	5180	18.256	5170.8751	5189.1311	---	---
11N20SISO	Ant1	5220	18.281	5210.9349	5229.2159	---	---
11N20SISO	Ant1	5240	18.192	5230.9477	5249.1397	---	---
11N20SISO	Ant1	5260	18.232	5250.8811	5269.1131	---	---
11N20SISO	Ant1	5300	18.270	5290.9391	5309.2091	---	---
11N20SISO	Ant1	5320	18.182	5310.9734	5329.1554	---	---
11N20SISO	Ant1	5500	18.443	5490.8863	5509.3293	---	---
11N20SISO	Ant1	5580	18.484	5570.8929	5589.3769	---	---
11N20SISO	Ant1	5700	18.309	5690.9461	5709.2551	---	---
11N20SISO	Ant1	5745	18.450	5735.8236	5754.2736	---	---
11N20SISO	Ant1	5785	18.404	5775.8782	5794.2822	---	---
11N20SISO	Ant1	5825	18.506	5815.8157	5834.3217	---	---
11N40SISO	Ant1	5190	36.688	5171.7279	5208.4159	---	---
11N40SISO	Ant1	5230	36.586	5211.8000	5248.3860	---	---
11N40SISO	Ant1	5270	36.788	5251.6580	5288.4460	---	---
11N40SISO	Ant1	5310	36.703	5291.7863	5328.4893	---	---
11N40SISO	Ant1	5510	36.878	5491.7579	5528.6359	---	---
11N40SISO	Ant1	5550	36.937	5531.7835	5568.7205	---	---
11N40SISO	Ant1	5670	36.937	5651.7164	5688.6534	---	---
11N40SISO	Ant1	5755	37.018	5736.6602	5773.6782	---	---
11N40SISO	Ant1	5795	36.876	5776.6777	5813.5537	---	---
11AC20SISO	Ant1	5180	18.189	5170.9438	5189.1328	---	---
11AC20SISO	Ant1	5220	18.274	5210.9079	5229.1819	---	---
11AC20SISO	Ant1	5240	18.197	5230.9519	5249.1489	---	---
11AC20SISO	Ant1	5260	18.322	5250.8558	5269.1778	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AC20SISO	Ant1	5300	18.333	5290.9095	5309.2425	---	---
11AC20SISO	Ant1	5320	18.291	5310.9403	5329.2313	---	---
11AC20SISO	Ant1	5500	18.440	5490.8757	5509.3157	---	---
11AC20SISO	Ant1	5580	18.440	5570.7832	5589.2232	---	---
11AC20SISO	Ant1	5700	18.486	5690.7660	5709.2520	---	---
11AC20SISO	Ant1	5745	18.398	5735.8331	5754.2311	---	---
11AC20SISO	Ant1	5785	18.404	5775.7742	5794.1782	---	---
11AC20SISO	Ant1	5825	18.353	5815.8374	5834.1904	---	---
11AC40SISO	Ant1	5190	36.632	5171.7537	5208.3857	---	---
11AC40SISO	Ant1	5230	36.593	5211.7239	5248.3169	---	---
11AC40SISO	Ant1	5270	36.614	5251.8129	5288.4269	---	---
11AC40SISO	Ant1	5310	36.655	5291.8065	5328.4615	---	---
11AC40SISO	Ant1	5510	36.977	5491.7225	5528.6995	---	---
11AC40SISO	Ant1	5550	36.797	5531.7907	5568.5877	---	---
11AC40SISO	Ant1	5670	36.823	5651.7187	5688.5417	---	---
11AC40SISO	Ant1	5755	37.054	5736.5614	5773.6154	---	---
11AC40SISO	Ant1	5795	36.832	5776.7562	5813.5882	---	---
11AC80SISO	Ant1	5210	76.379	5171.8532	5248.2322	---	---
11AC80SISO	Ant1	5290	76.148	5252.0441	5328.1921	---	---
11AC80SISO	Ant1	5530	76.340	5492.1807	5568.5207	---	---
11AC80SISO	Ant1	5775	76.953	5736.6244	5813.5774	---	---
11AX20SISO	Ant1	5180	19.302	5170.4758	5189.7778	---	---
11AX20SISO	Ant1	5220	19.274	5210.4752	5229.7492	---	---
11AX20SISO	Ant1	5240	19.280	5230.4496	5249.7296	---	---
11AX20SISO	Ant1	5260	19.311	5250.4472	5269.7582	---	---
11AX20SISO	Ant1	5300	19.264	5290.5040	5309.7680	---	---
11AX20SISO	Ant1	5320	19.347	5310.5018	5329.8488	---	---
11AX20SISO	Ant1	5500	19.619	5490.4465	5510.0655	---	---
11AX20SISO	Ant1	5580	19.521	5570.4206	5589.9416	---	---
11AX20SISO	Ant1	5700	19.409	5690.4048	5709.8138	---	---
11AX20SISO	Ant1	5745	19.499	5735.4019	5754.9009	---	---
11AX20SISO	Ant1	5785	19.455	5775.4268	5794.8818	---	---
11AX20SISO	Ant1	5825	19.464	5815.4320	5834.8960	---	---
11AX40SISO	Ant1	5190	38.380	5170.9104	5209.2904	---	---
11AX40SISO	Ant1	5230	38.231	5210.9735	5249.2045	---	---
11AX40SISO	Ant1	5270	38.364	5250.9607	5289.3247	---	---
11AX40SISO	Ant1	5310	38.261	5291.0068	5329.2678	---	---
11AX40SISO	Ant1	5510	38.537	5491.0061	5529.5431	---	---
11AX40SISO	Ant1	5550	38.572	5530.9596	5569.5316	---	---
11AX40SISO	Ant1	5670	38.569	5650.8889	5689.4579	---	---
11AX40SISO	Ant1	5755	38.395	5735.8915	5774.2865	---	---
11AX40SISO	Ant1	5795	38.566	5775.7928	5814.3588	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX80SISO	Ant1	5210	77.544	5171.5248	5249.0688	---	---
11AX80SISO	Ant1	5290	77.496	5251.4606	5328.9566	---	---
11AX80SISO	Ant1	5530	77.799	5491.5064	5569.3054	---	---
11AX80SISO	Ant1	5775	78.015	5736.0879	5814.1029	---	---


Test Graphs



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

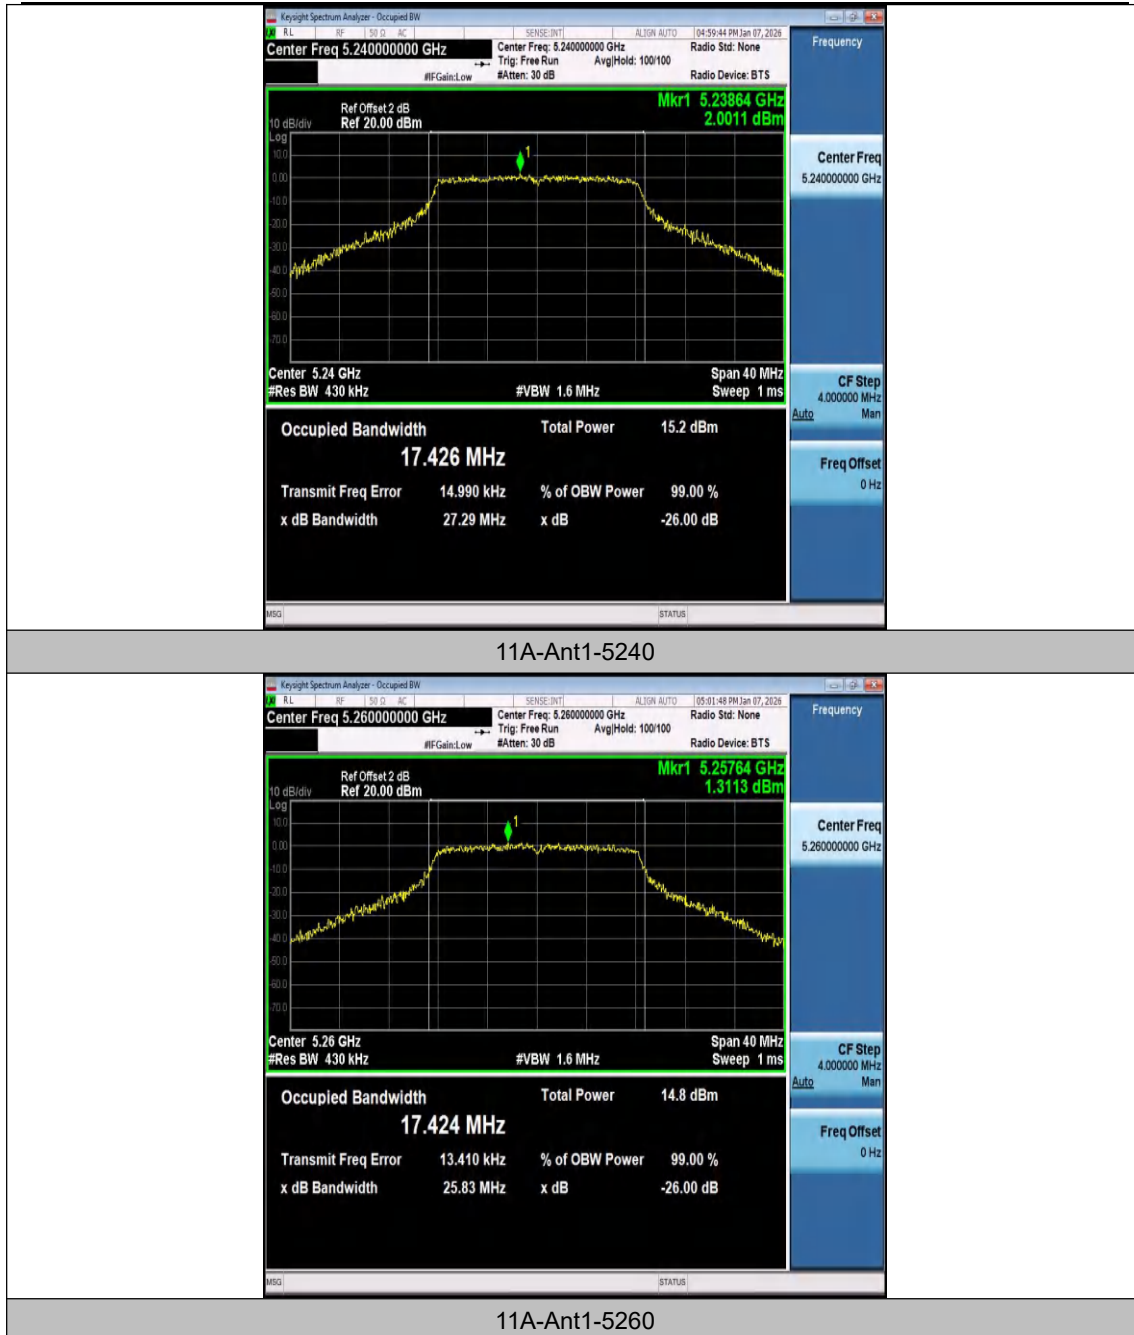

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

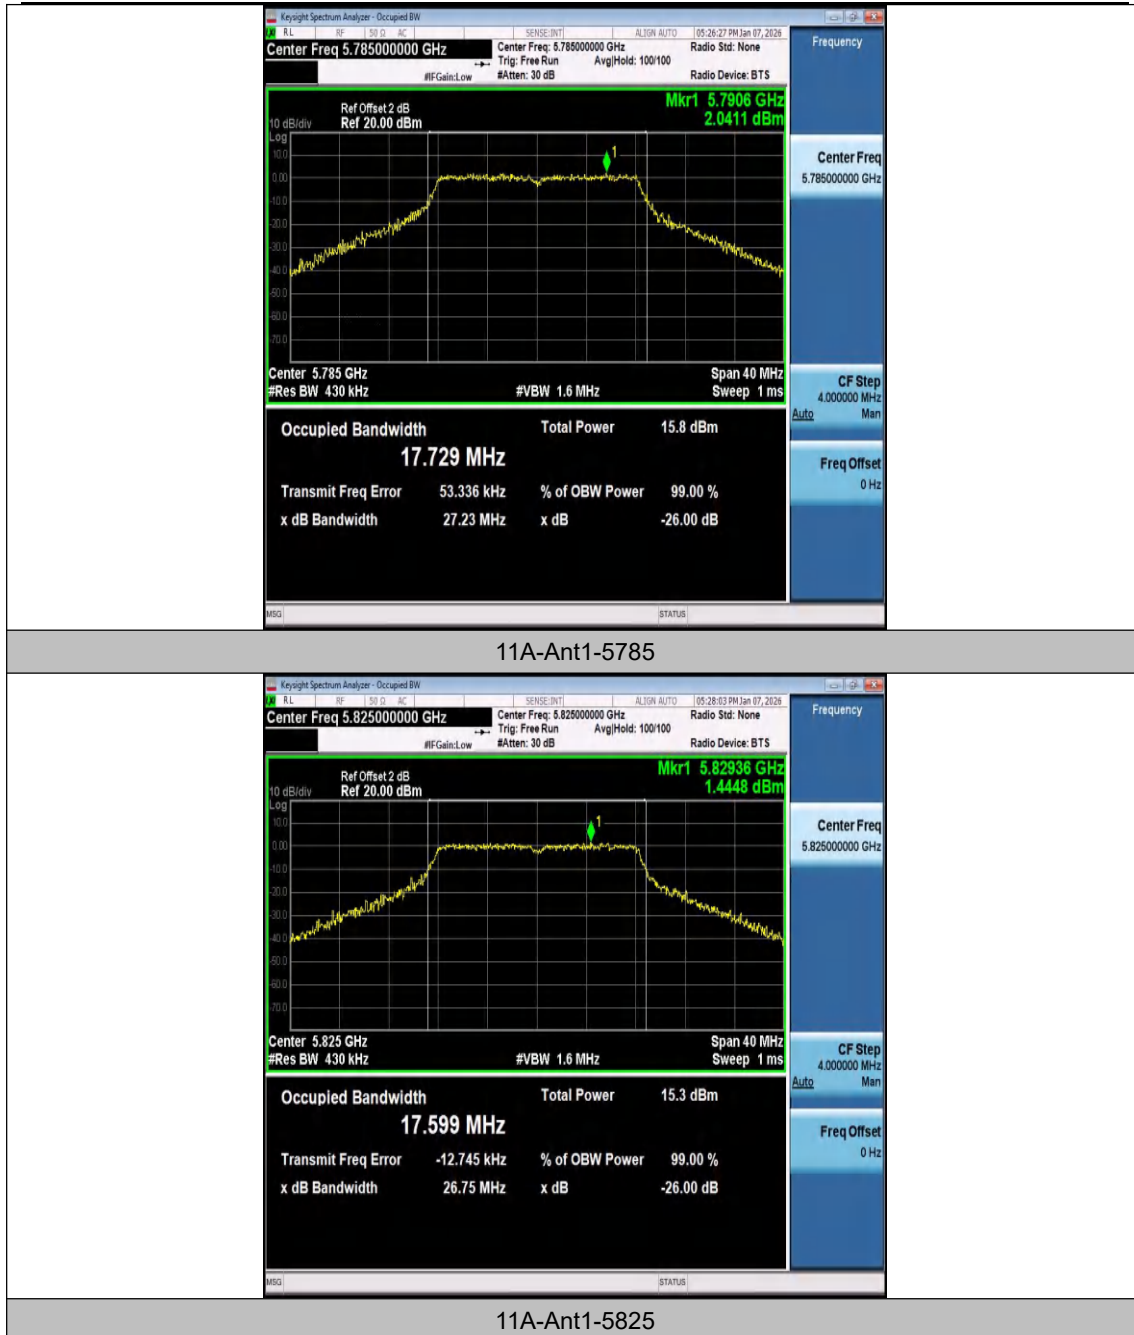

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

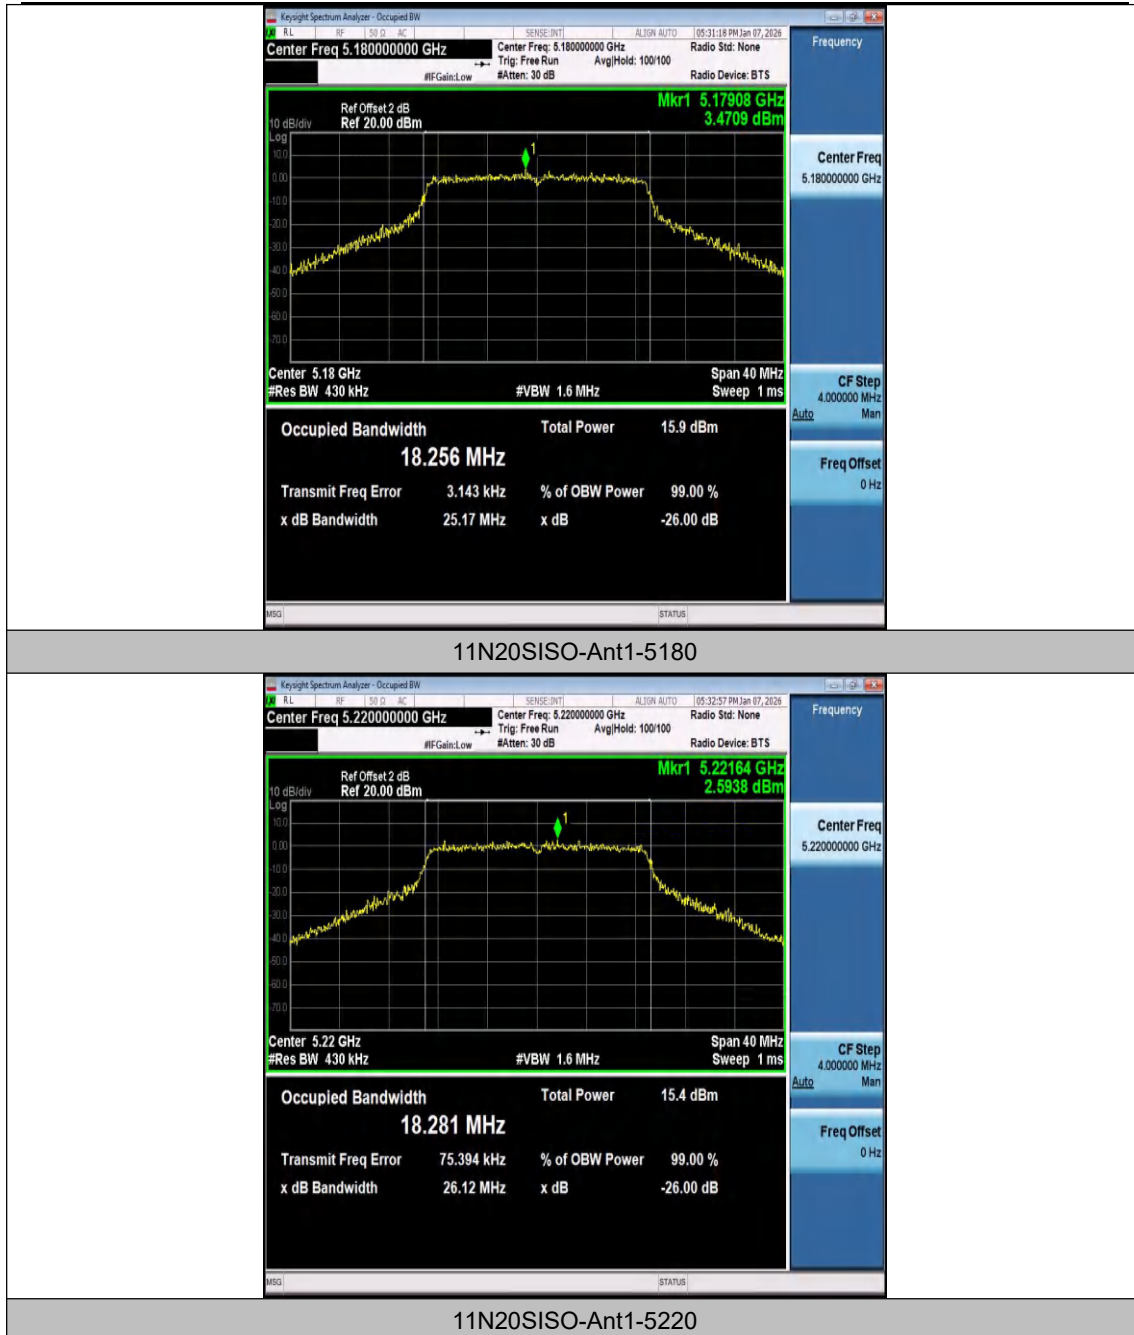

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

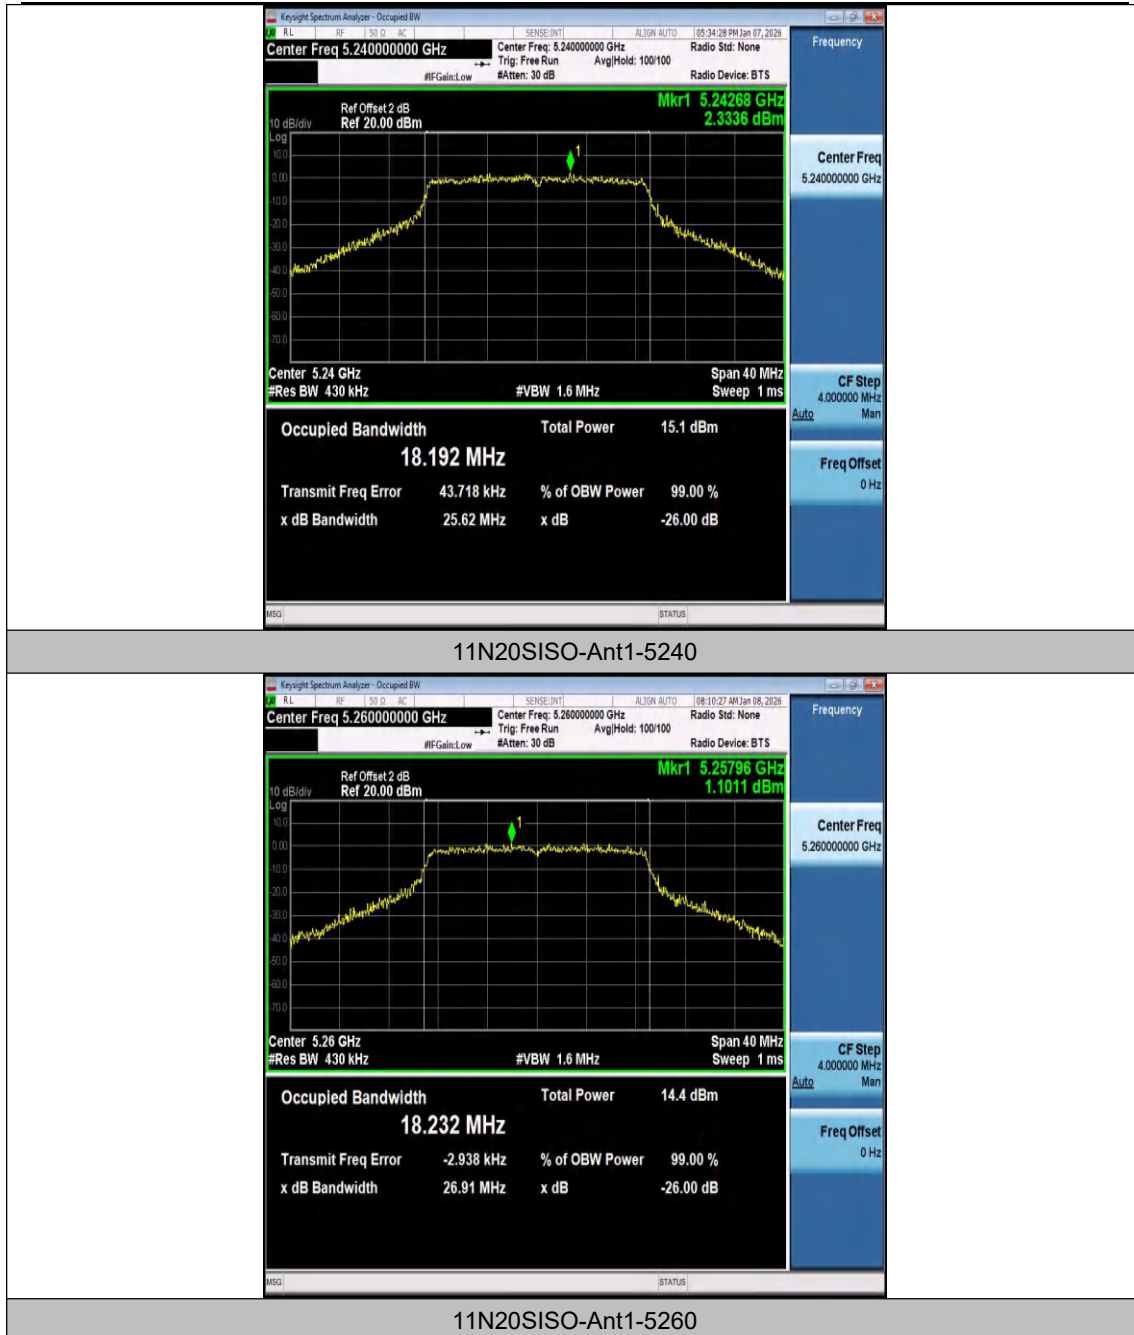

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

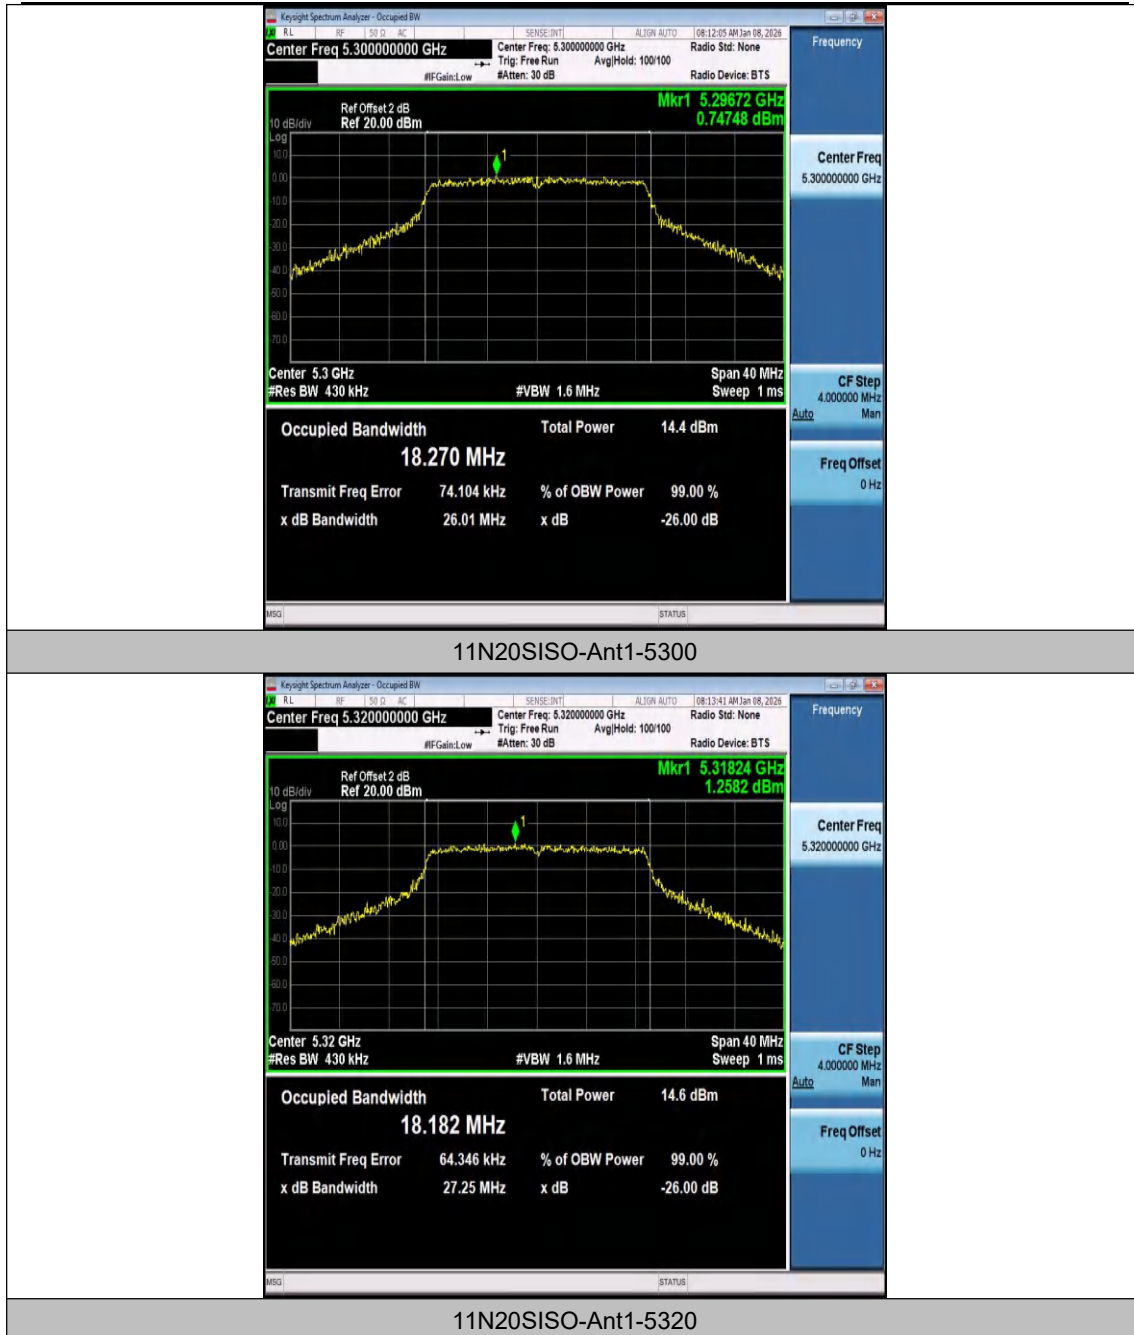

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

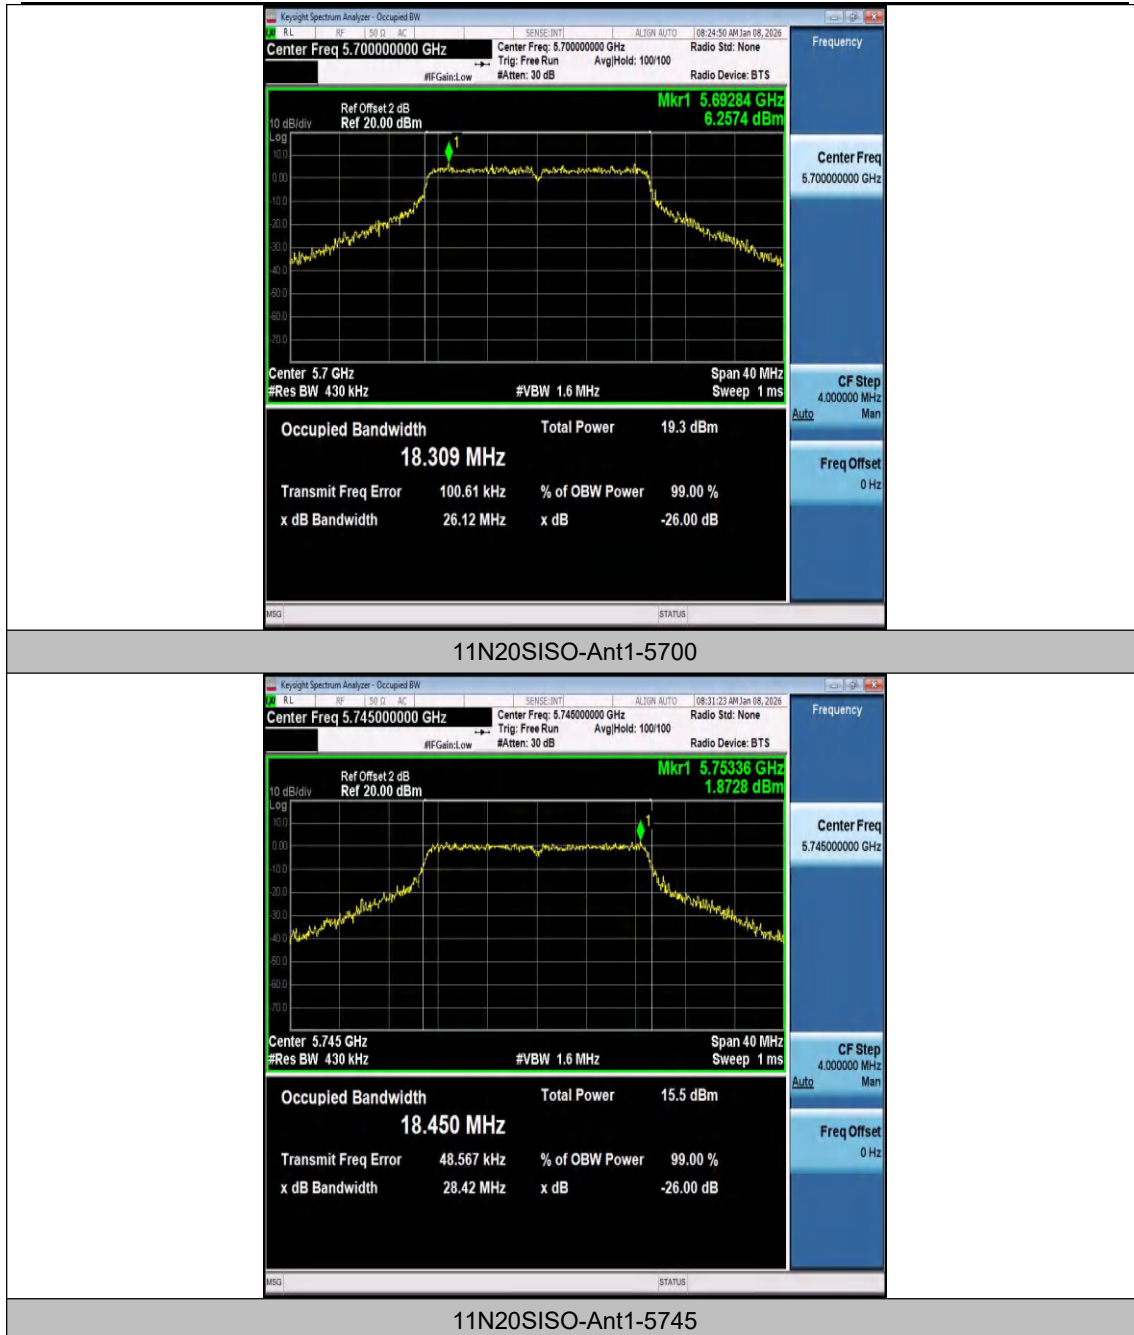


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

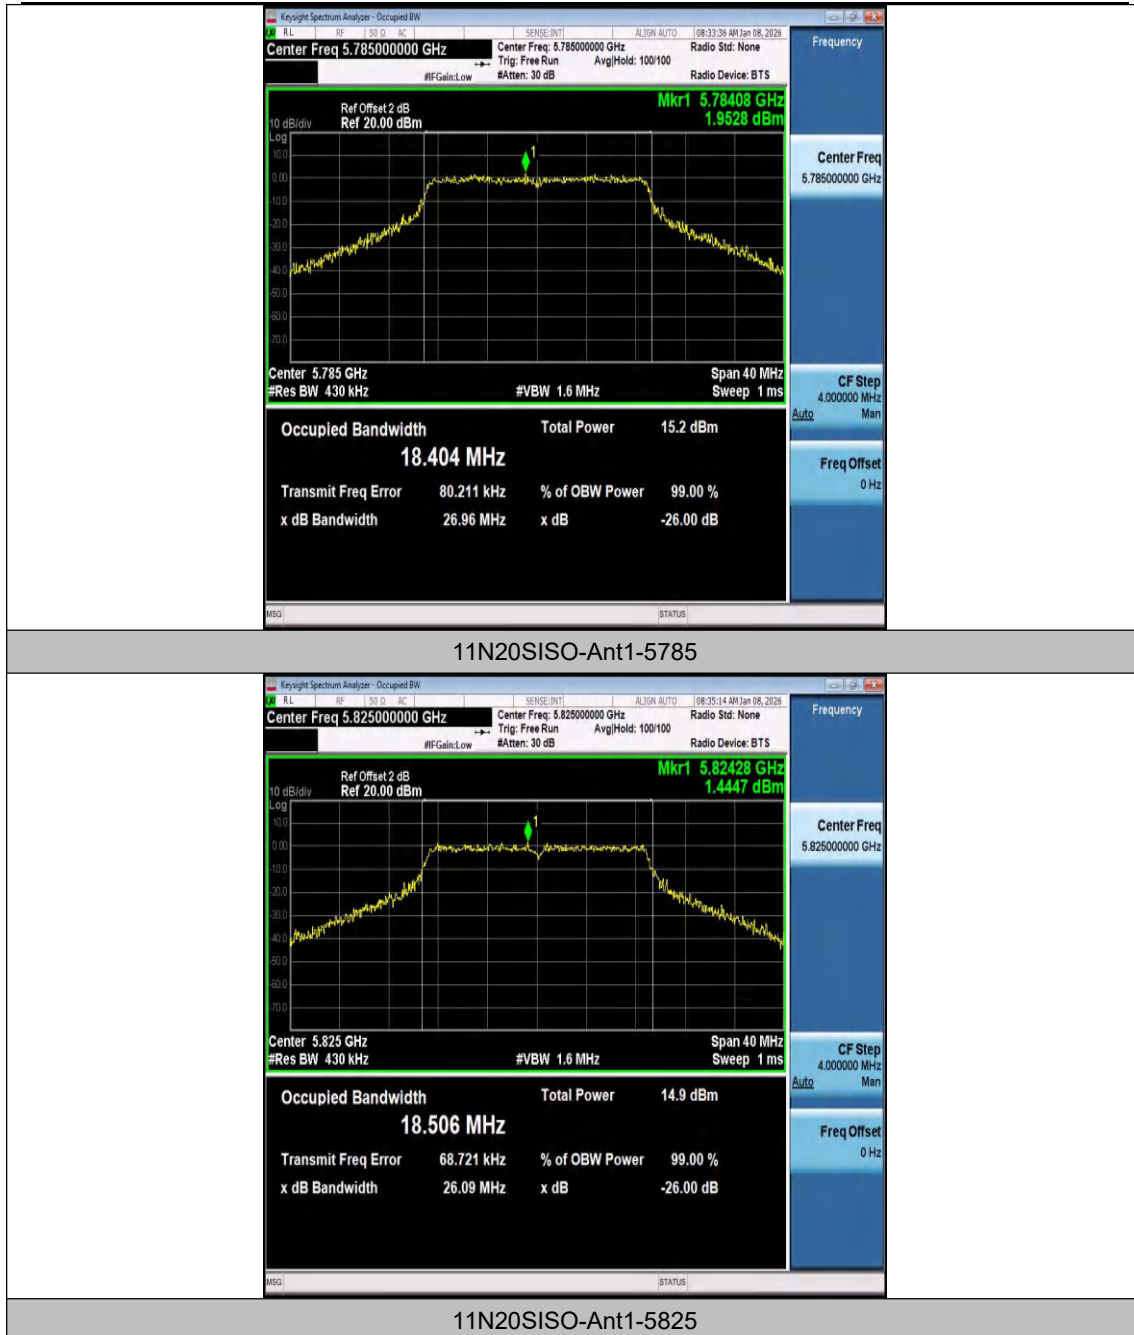


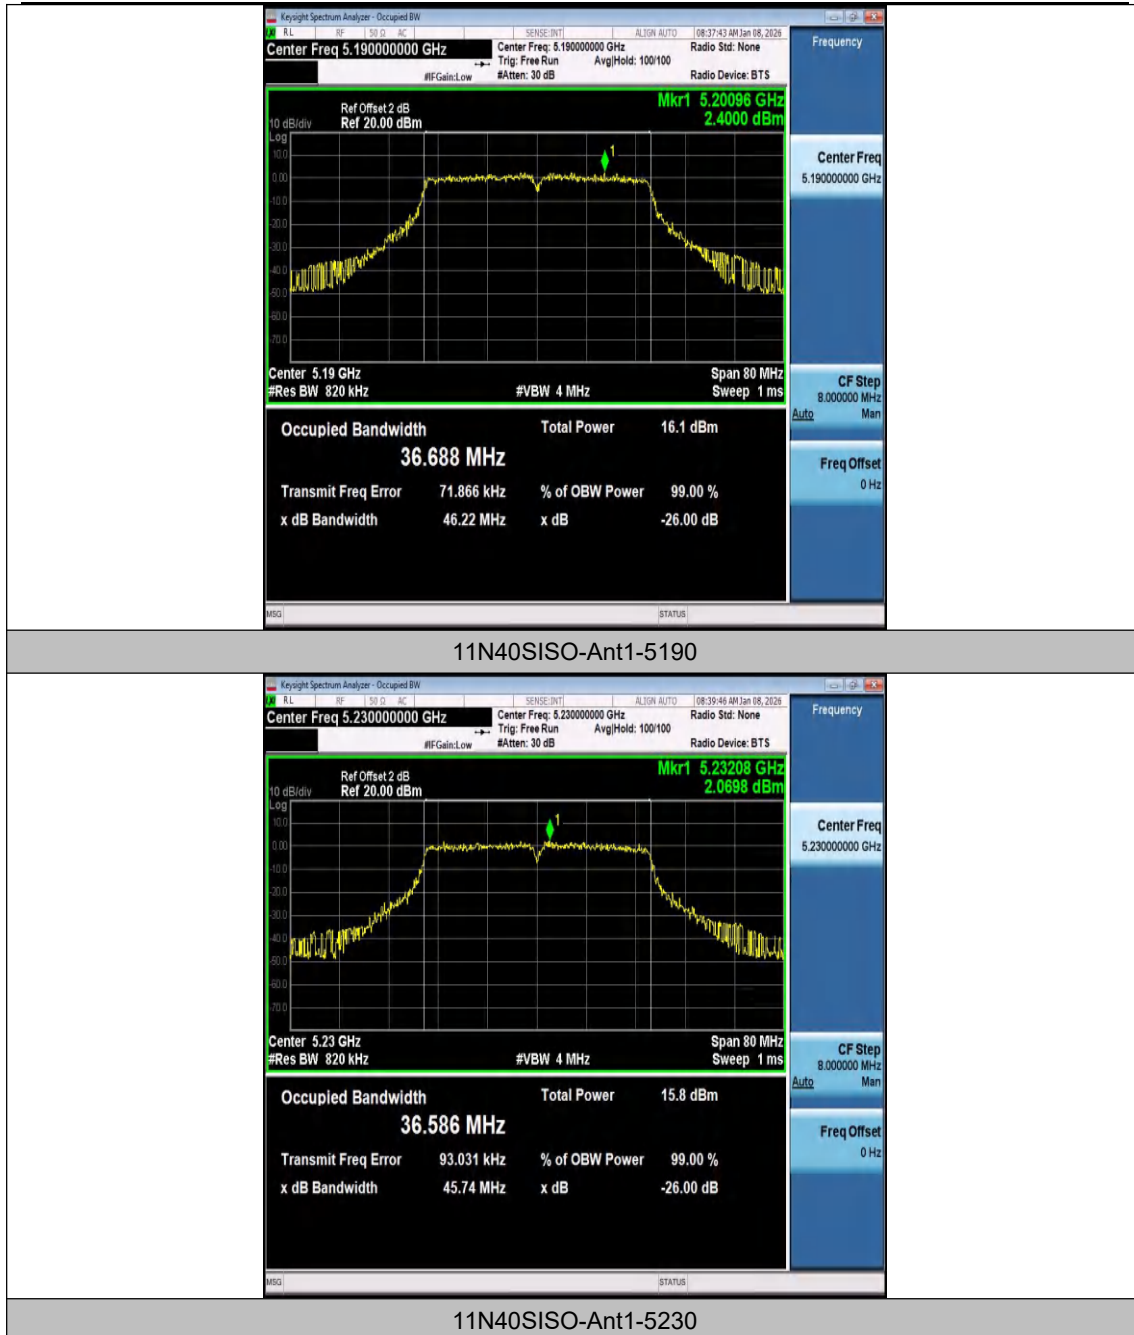

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

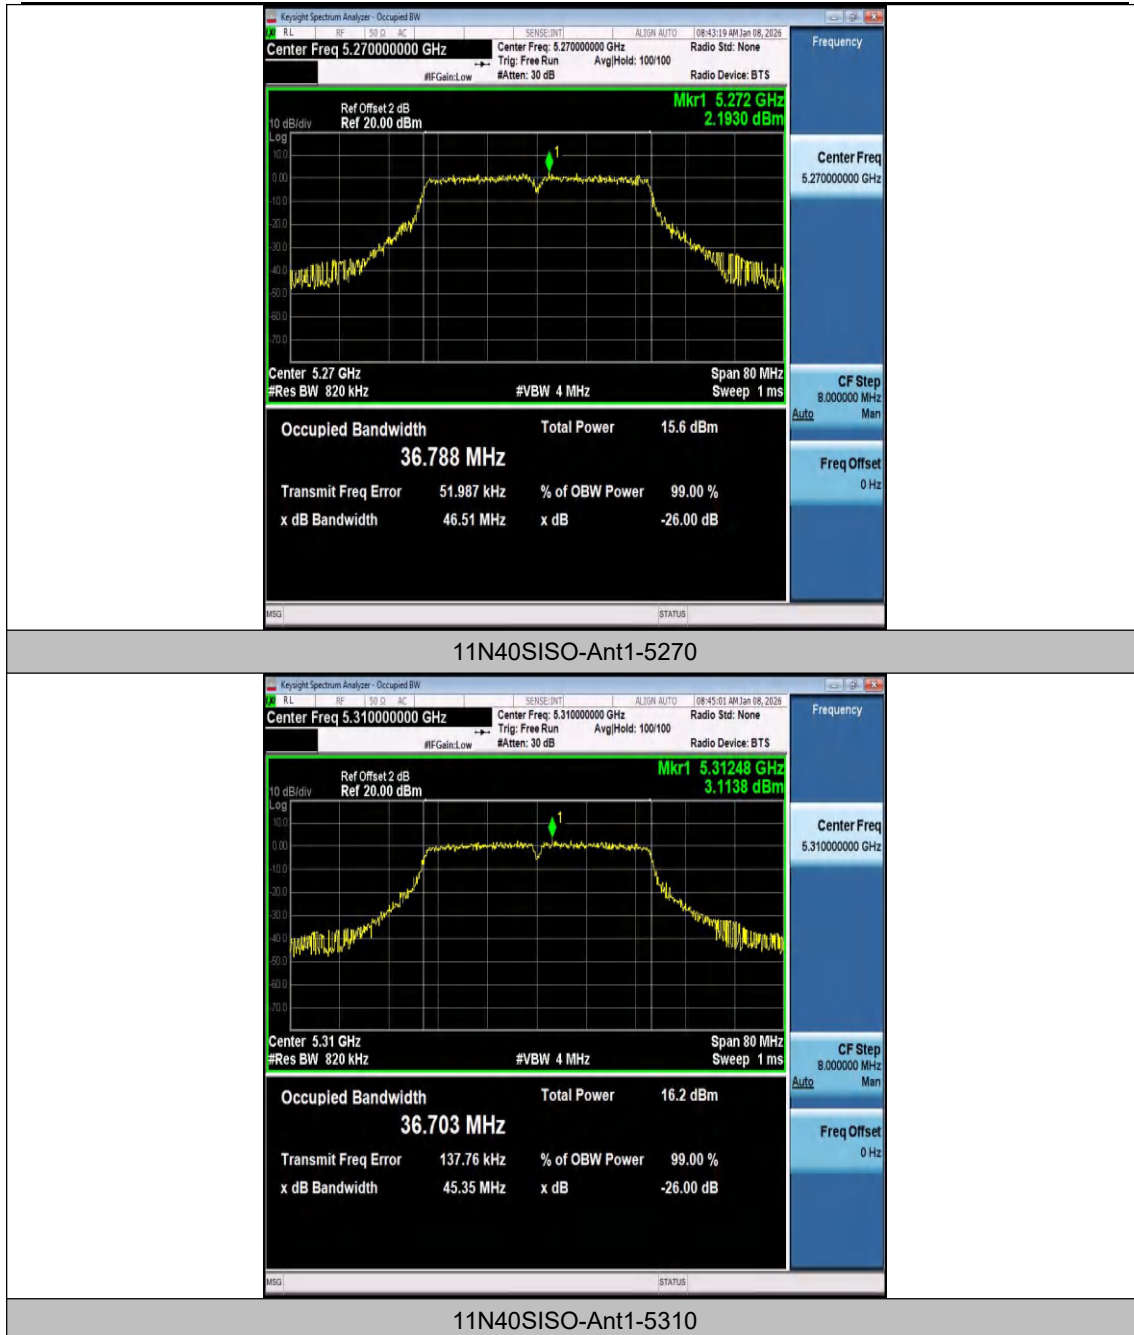

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

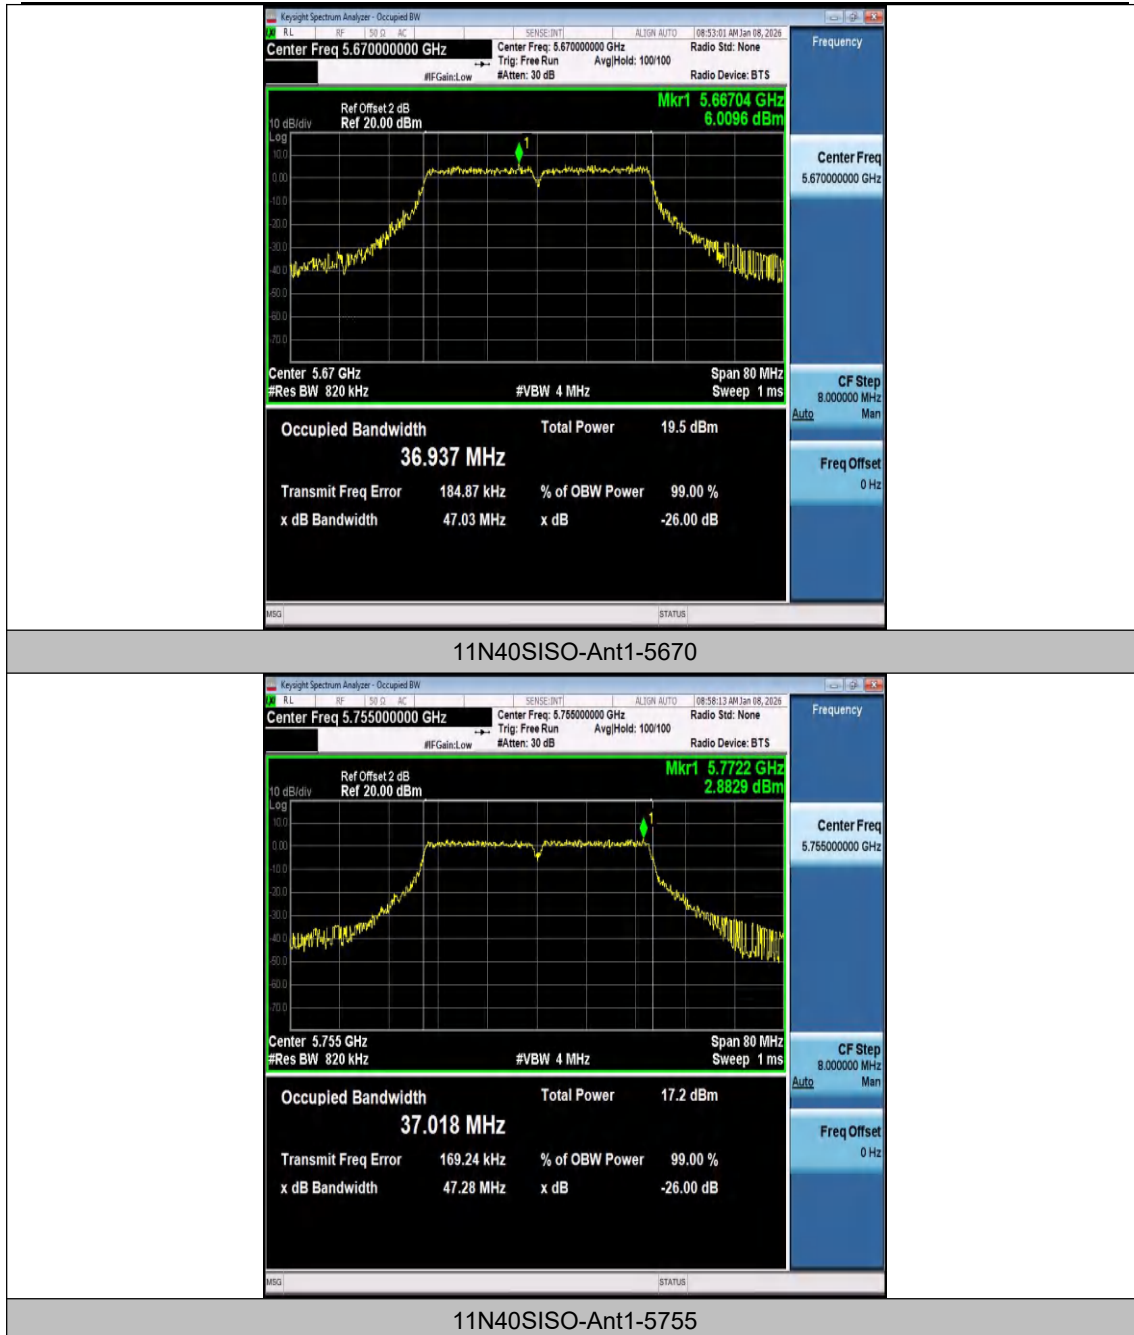

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

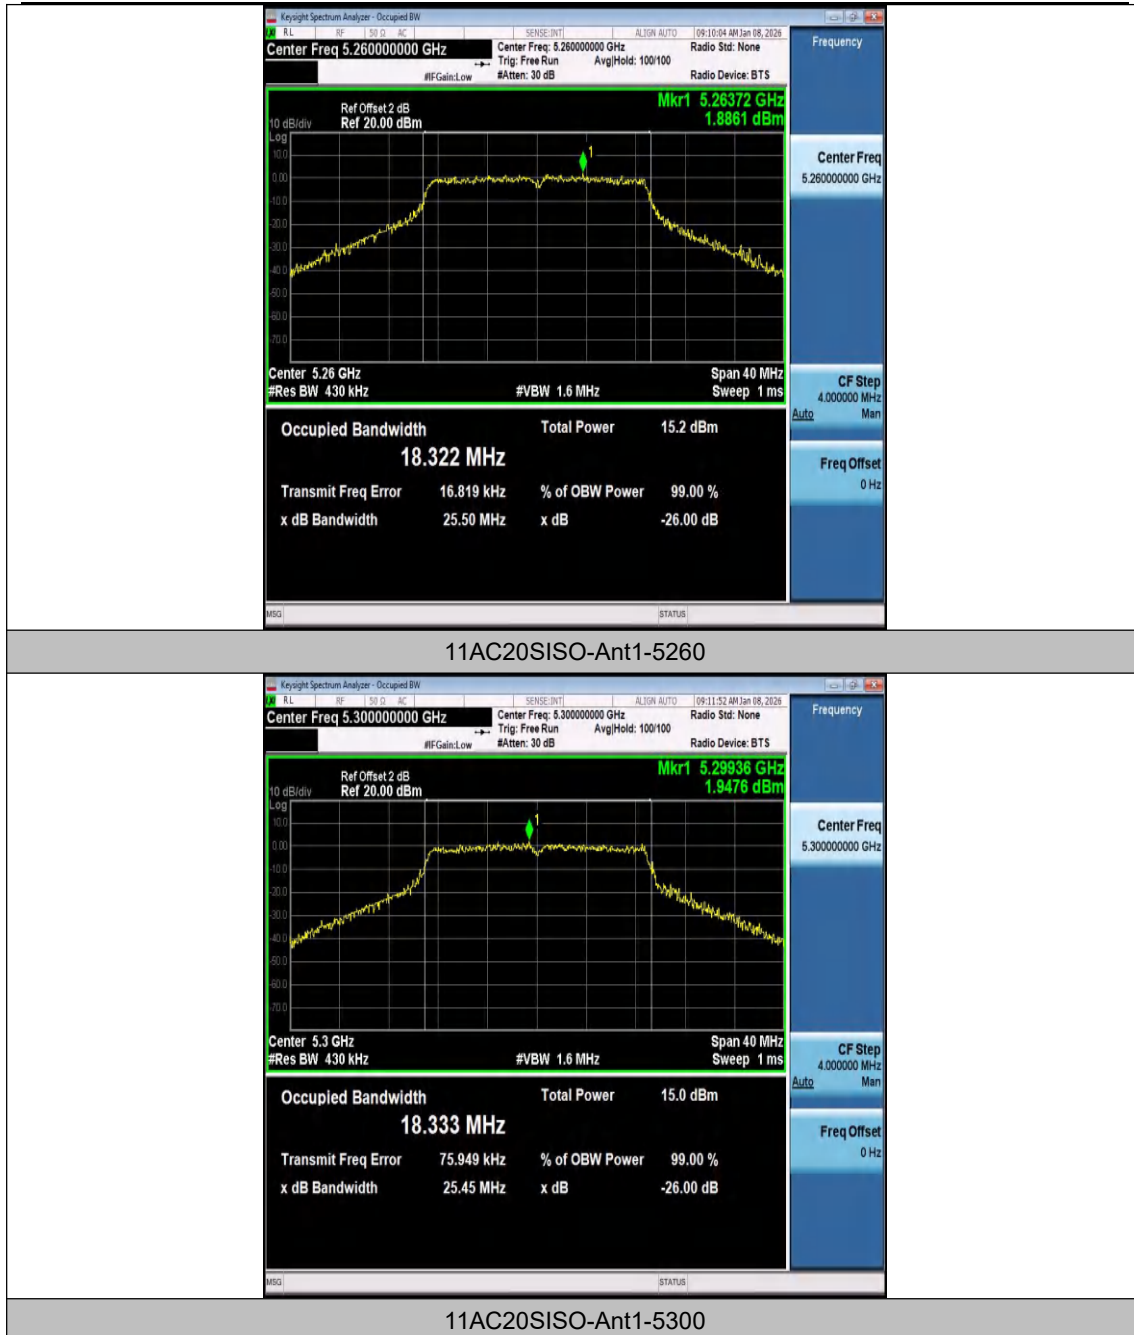

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com