




8DPSK_3DH1_HOPP_Ant1_NTNV

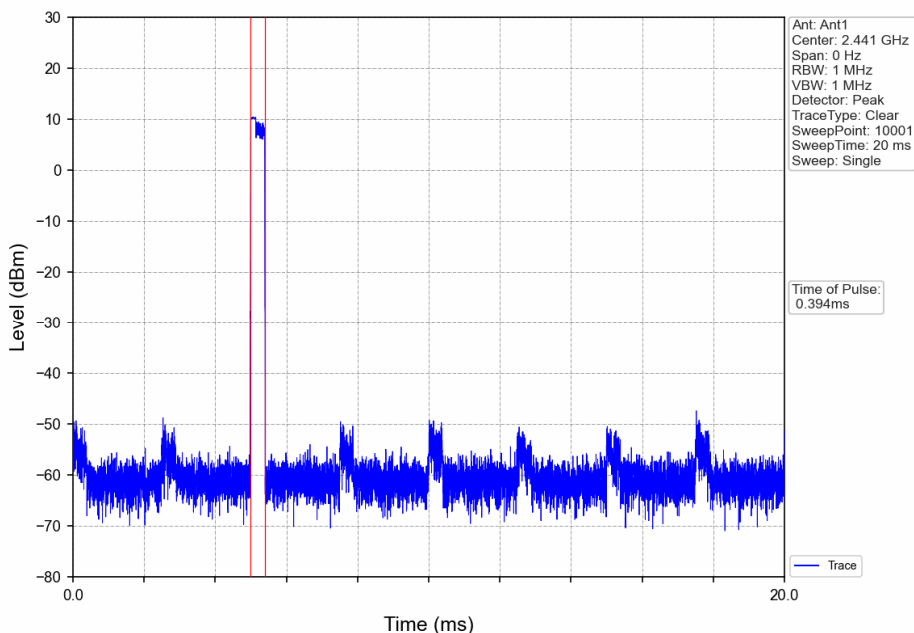


8DPSK_3DH1_HOPP_Ant1_NTNV

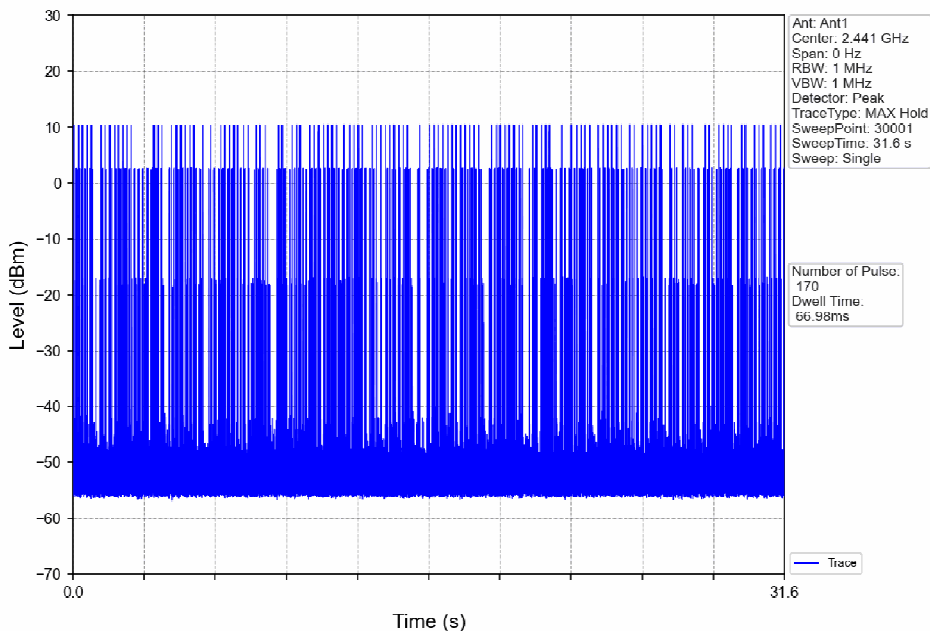


8DPSK_3DH3_HOPP_Ant1_NTNV

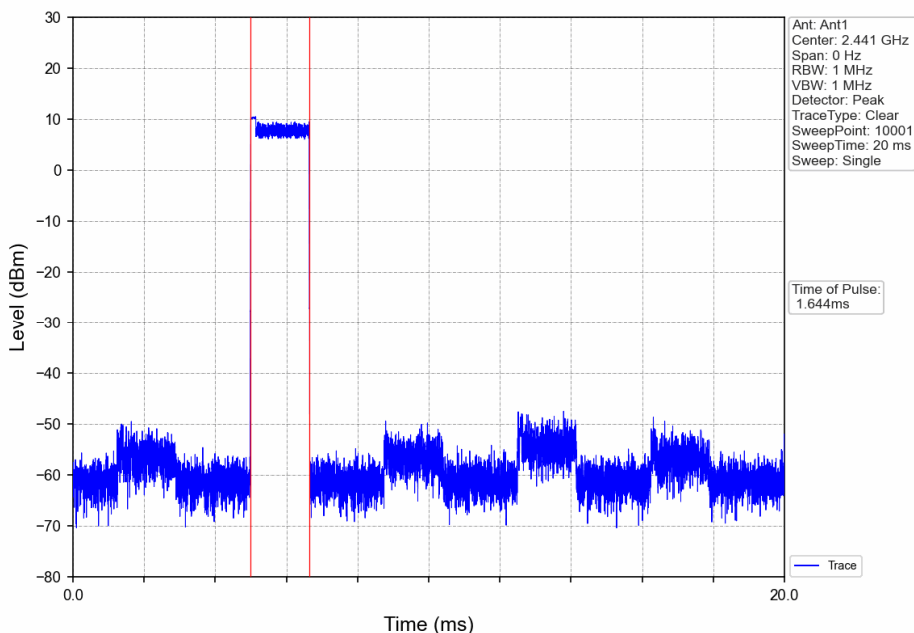


8DPSK_3DH3_HOPP_Ant1_NTNV

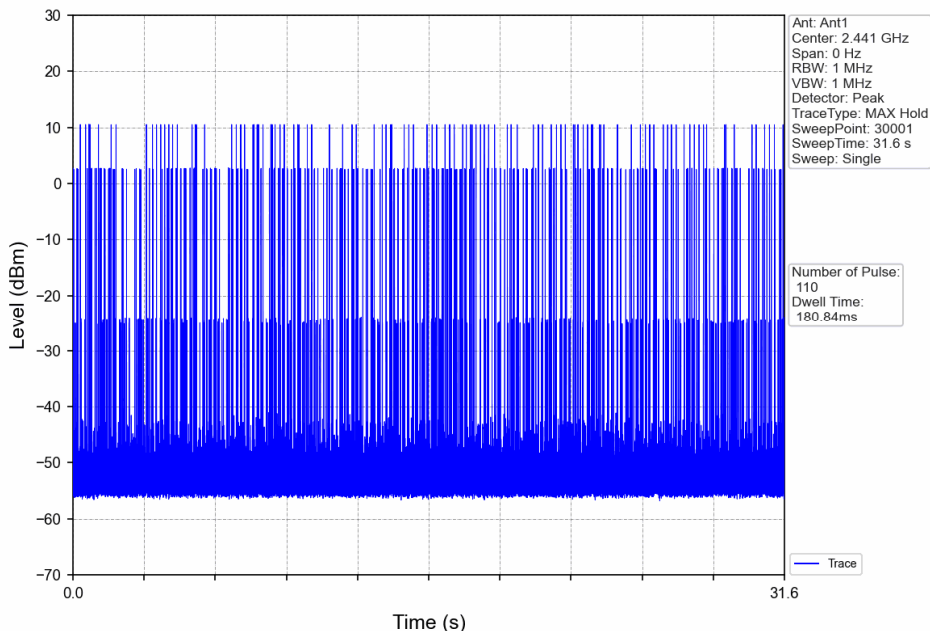

8DPSK_3DH5_HOPP_Ant1_NTNV

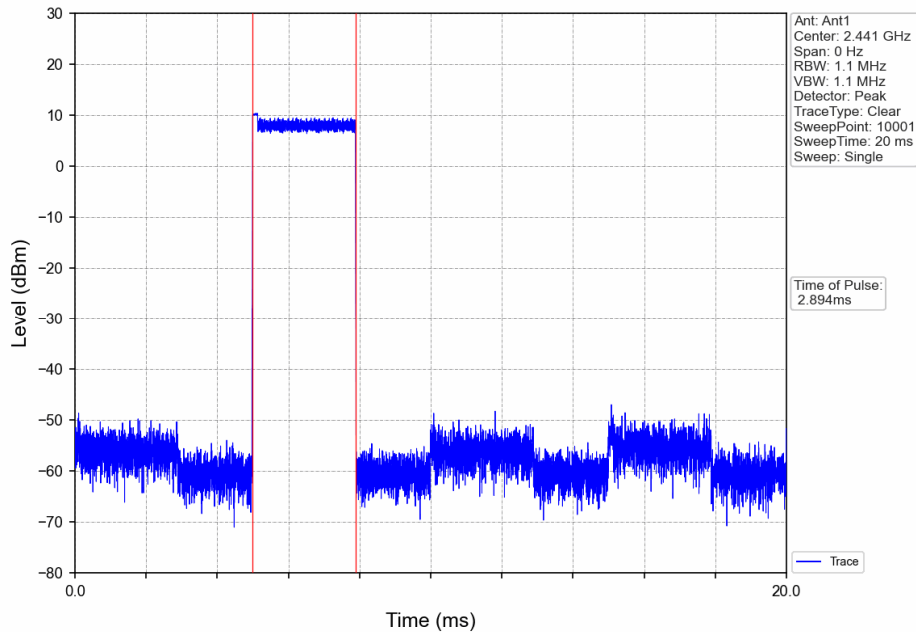

8DPSK_3DH5_HOPP_Ant1_NTNV

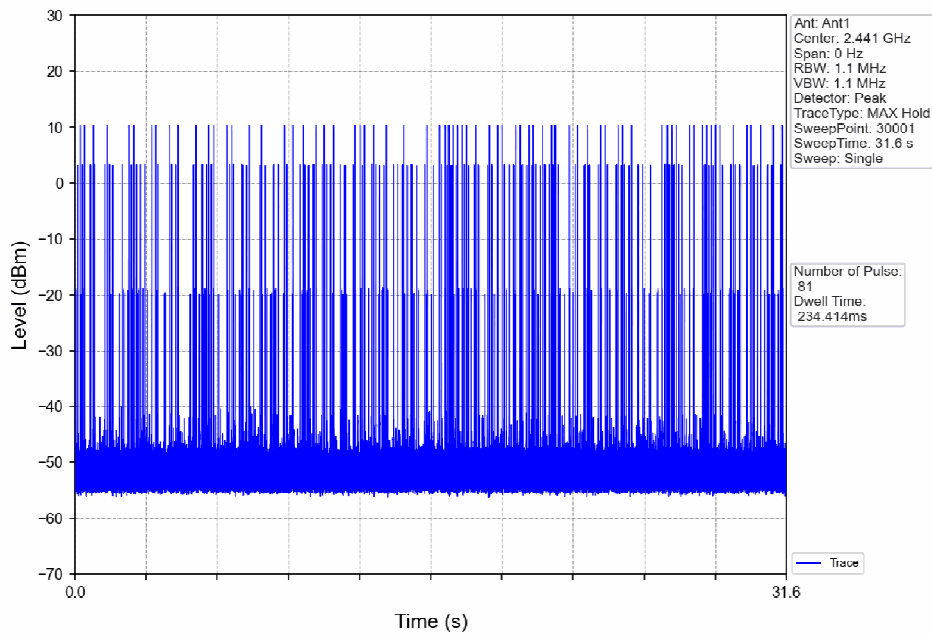


6. Unwanted Emissions In Non-restricted Frequency Bands

6.1 Ref


6.1.1 Test Result

Mode	TX Type	Frequency (MHz)	Packet Type	Ant	Level of Reference (dBm)
GFSK	SISO	2402	DH5	1	9.62
		2441	DH5	1	10.24
		2480	DH5	1	10.19
Pi/4DQPSK	SISO	2402	2DH5	1	9.40
		2441	2DH5	1	10.07
		2480	2DH5	1	10.10
8DPSK	SISO	2402	3DH5	1	9.43
		2441	3DH5	1	10.23
		2480	3DH5	1	10.10


6.1.2 Test Graph

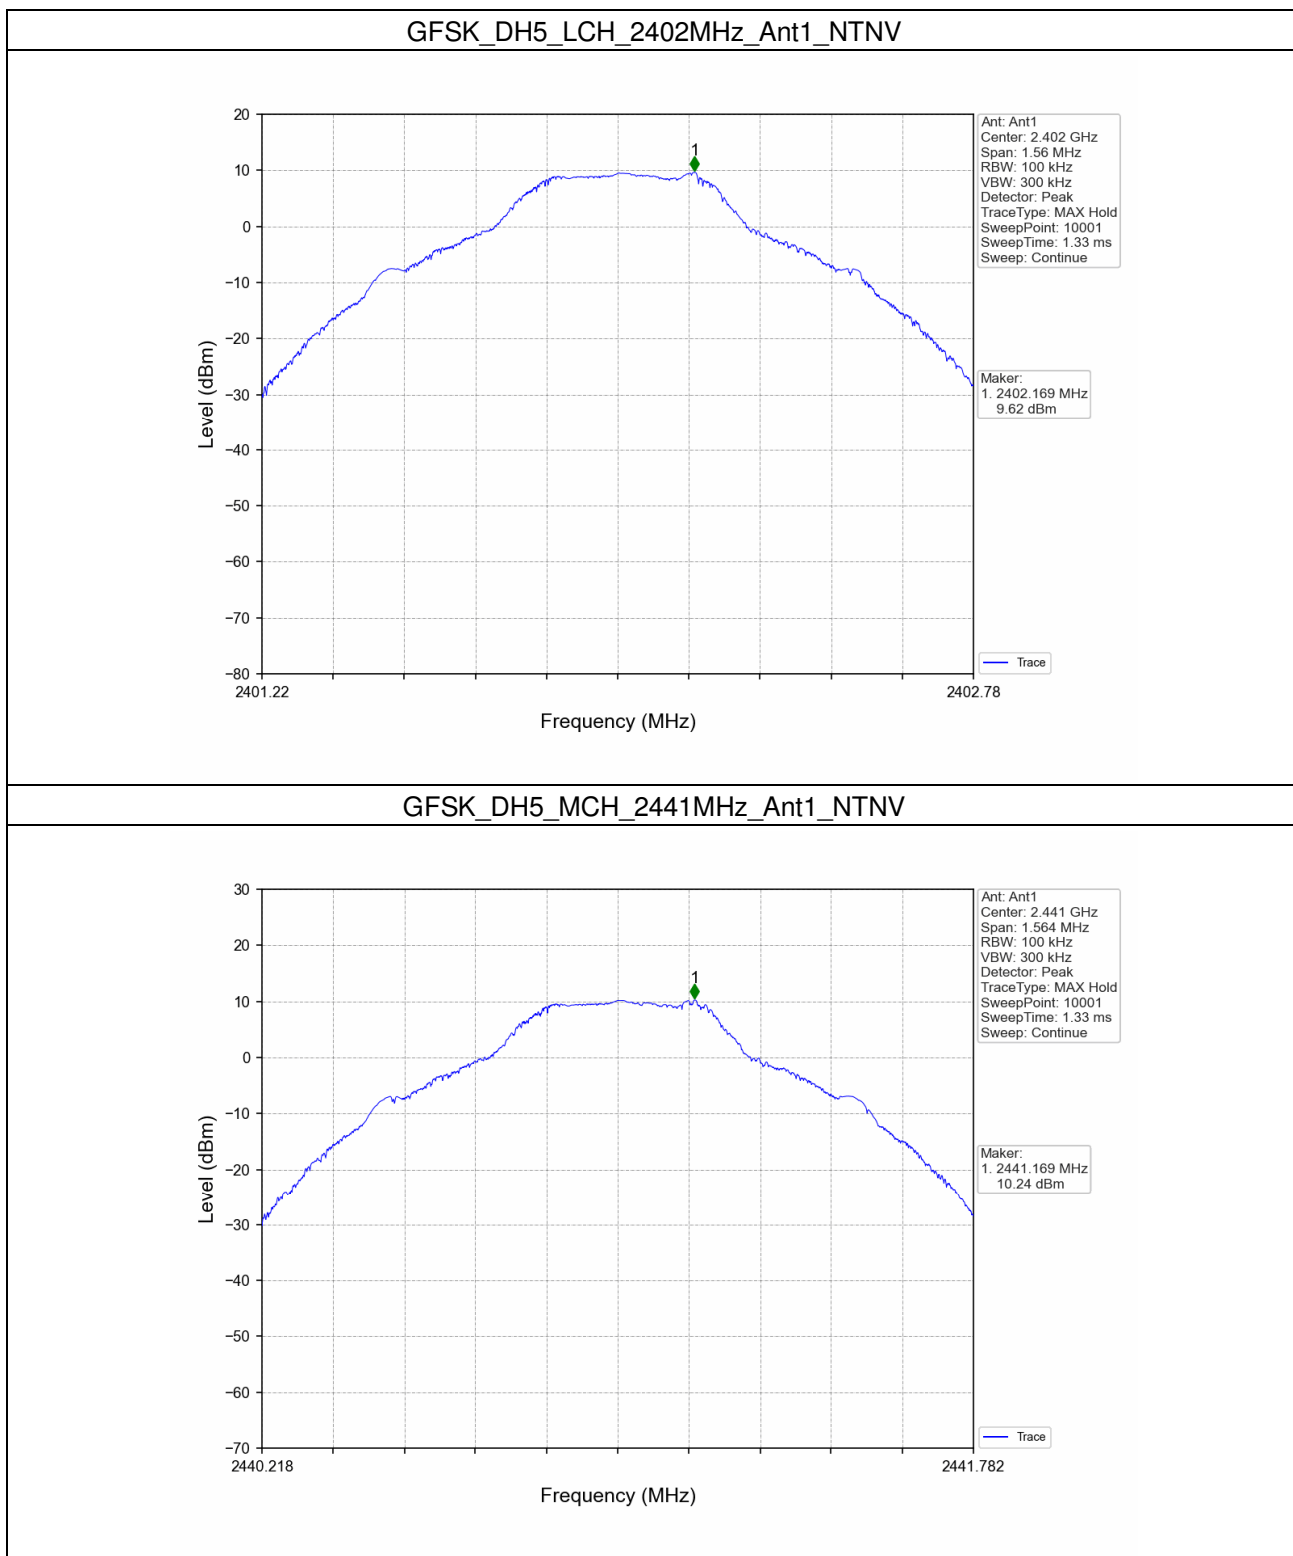


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

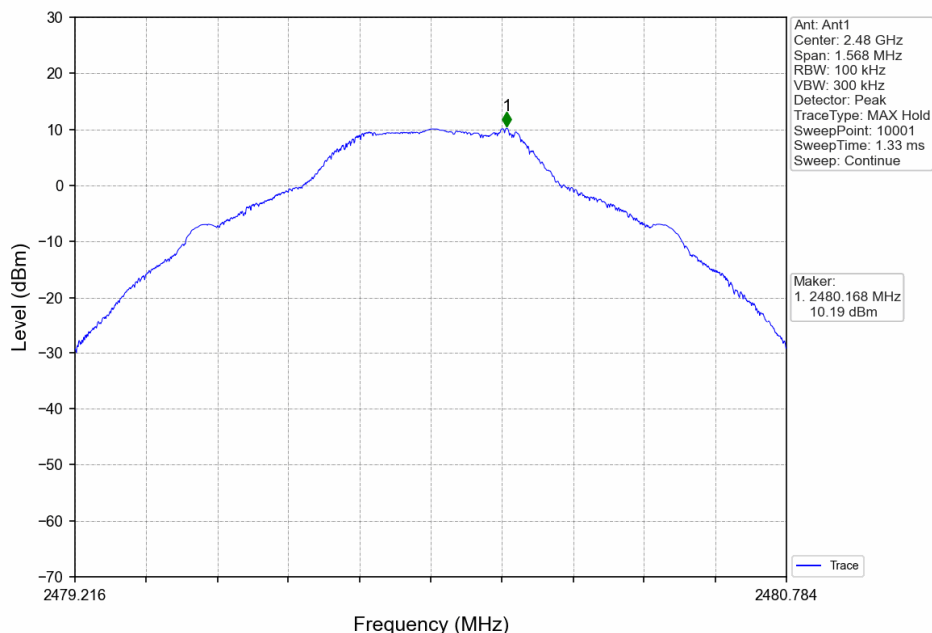


Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

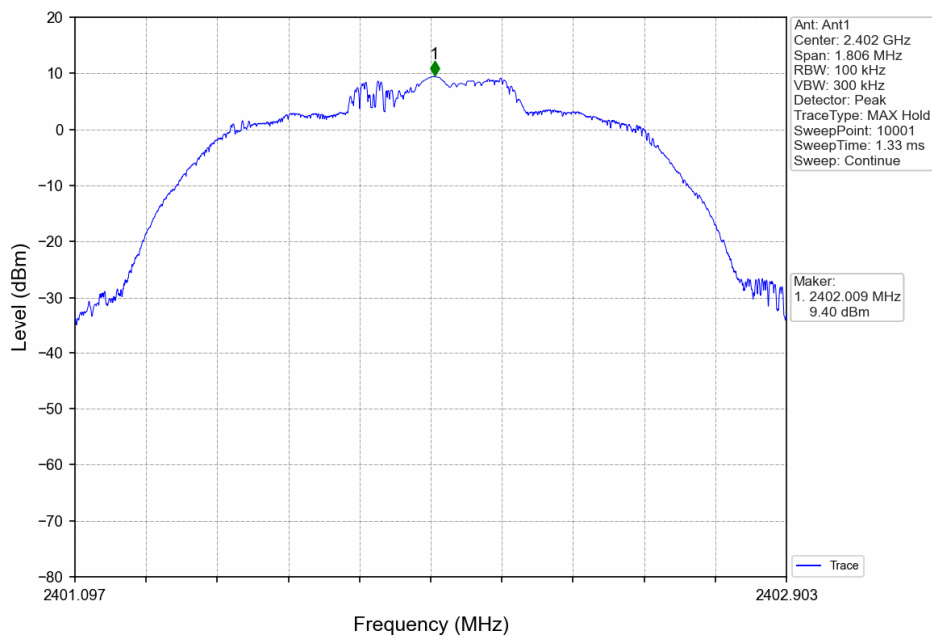


Pi/4DQPSK_2DH5_MCH_2441MHz_Ant1_NTNV

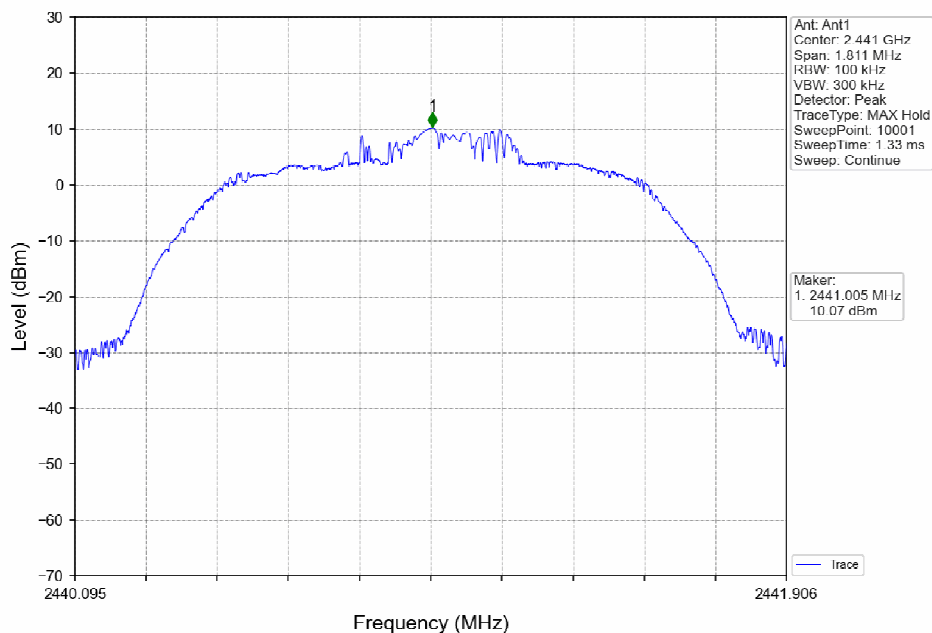


Pi/4DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

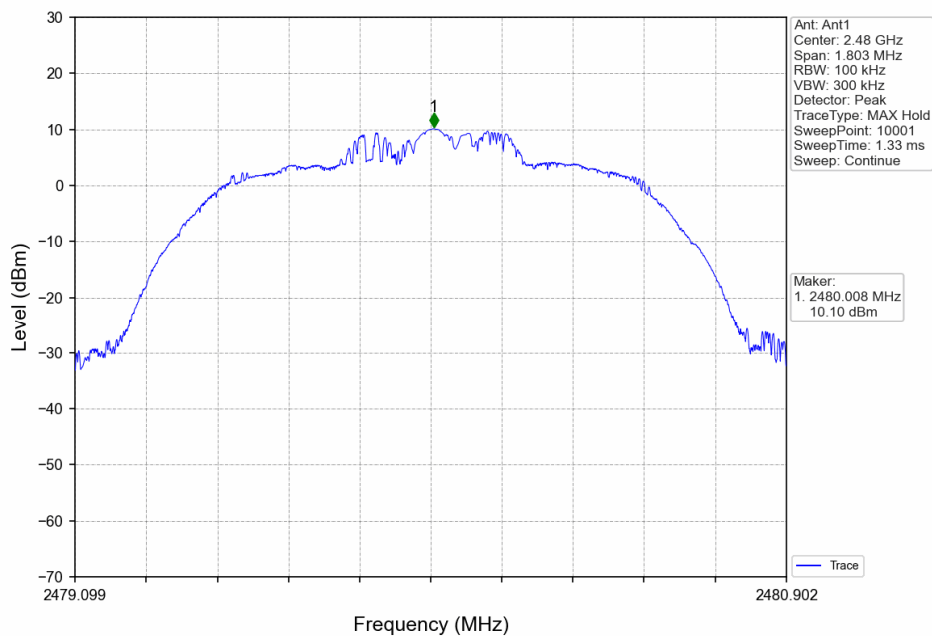


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

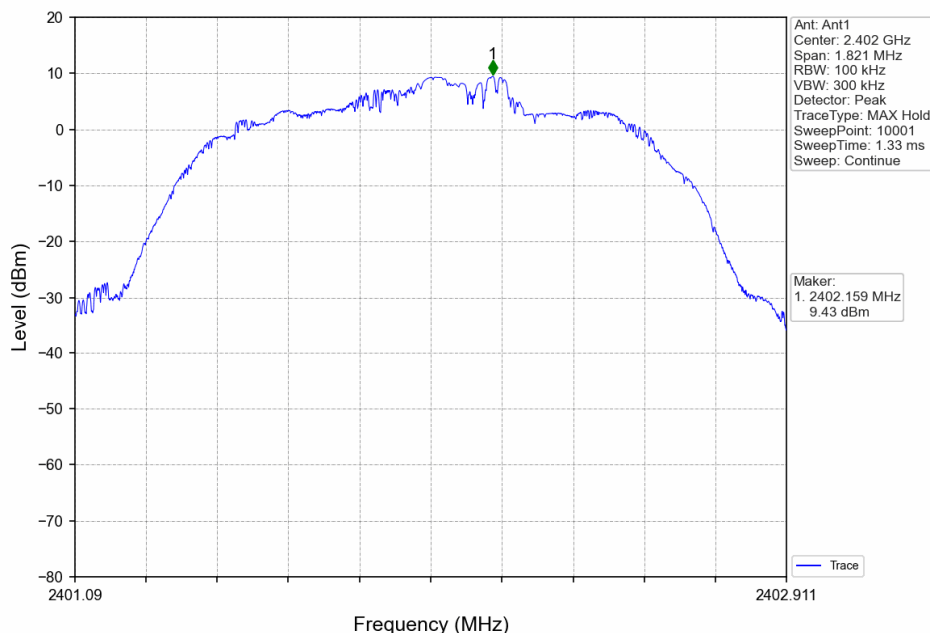

8DPSK_3DH5_MCH_2441MHz_Ant1_NTNV

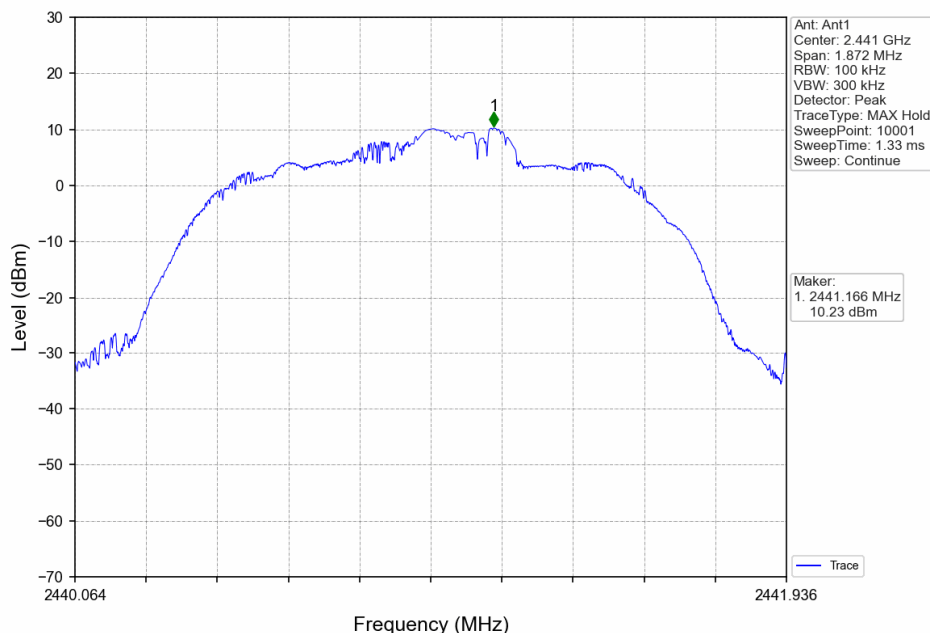

8DPSK_3DH5_HCH_2480MHz_Ant1_NTNV

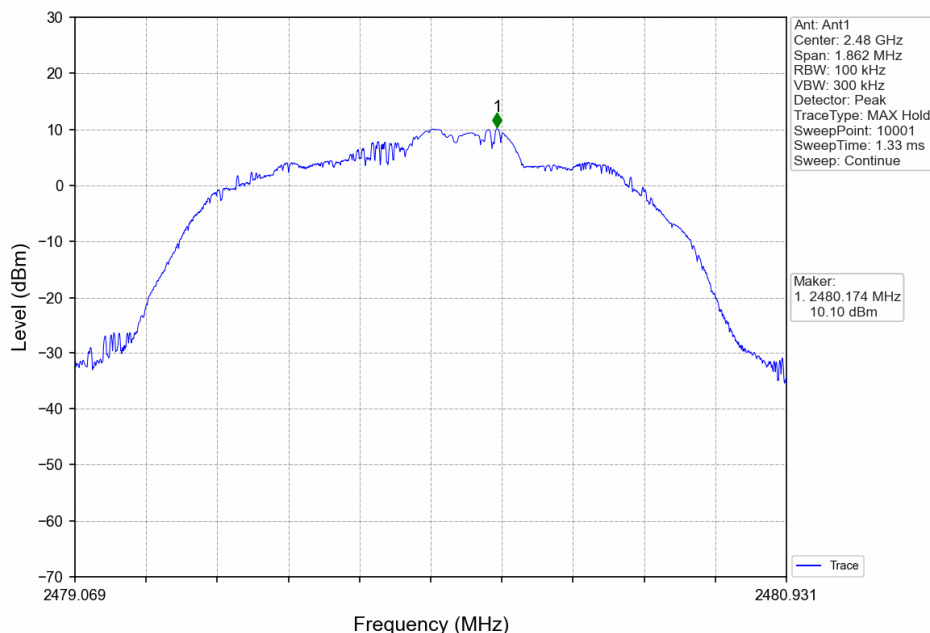

Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

6.2 CSE

6.2.1 Test Result


Mode	TX Type	Frequency (MHz)	Packet Type	Ant	Level of Reference (dBm)	Limit (dBm)	Verdict
GFSK	SISO	2402	DH5	1	10.24	-9.76	Pass
		2441	DH5	1	10.24	-9.76	Pass
		2480	DH5	1	10.24	-9.76	Pass
		HOPP	DH5	1	10.24	-9.76	Pass
Pi/4DQPSK	SISO	2402	2DH5	1	10.10	-9.90	Pass
		2441	2DH5	1	10.10	-9.90	Pass
		2480	2DH5	1	10.10	-9.90	Pass
		HOPP	2DH5	1	10.10	-9.90	Pass
8DPSK	SISO	2402	3DH5	1	10.23	-9.77	Pass
		2441	3DH5	1	10.23	-9.77	Pass
		2480	3DH5	1	10.23	-9.77	Pass
		HOPP	3DH5	1	10.23	-9.77	Pass




Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com


6.2.2 Test Graph

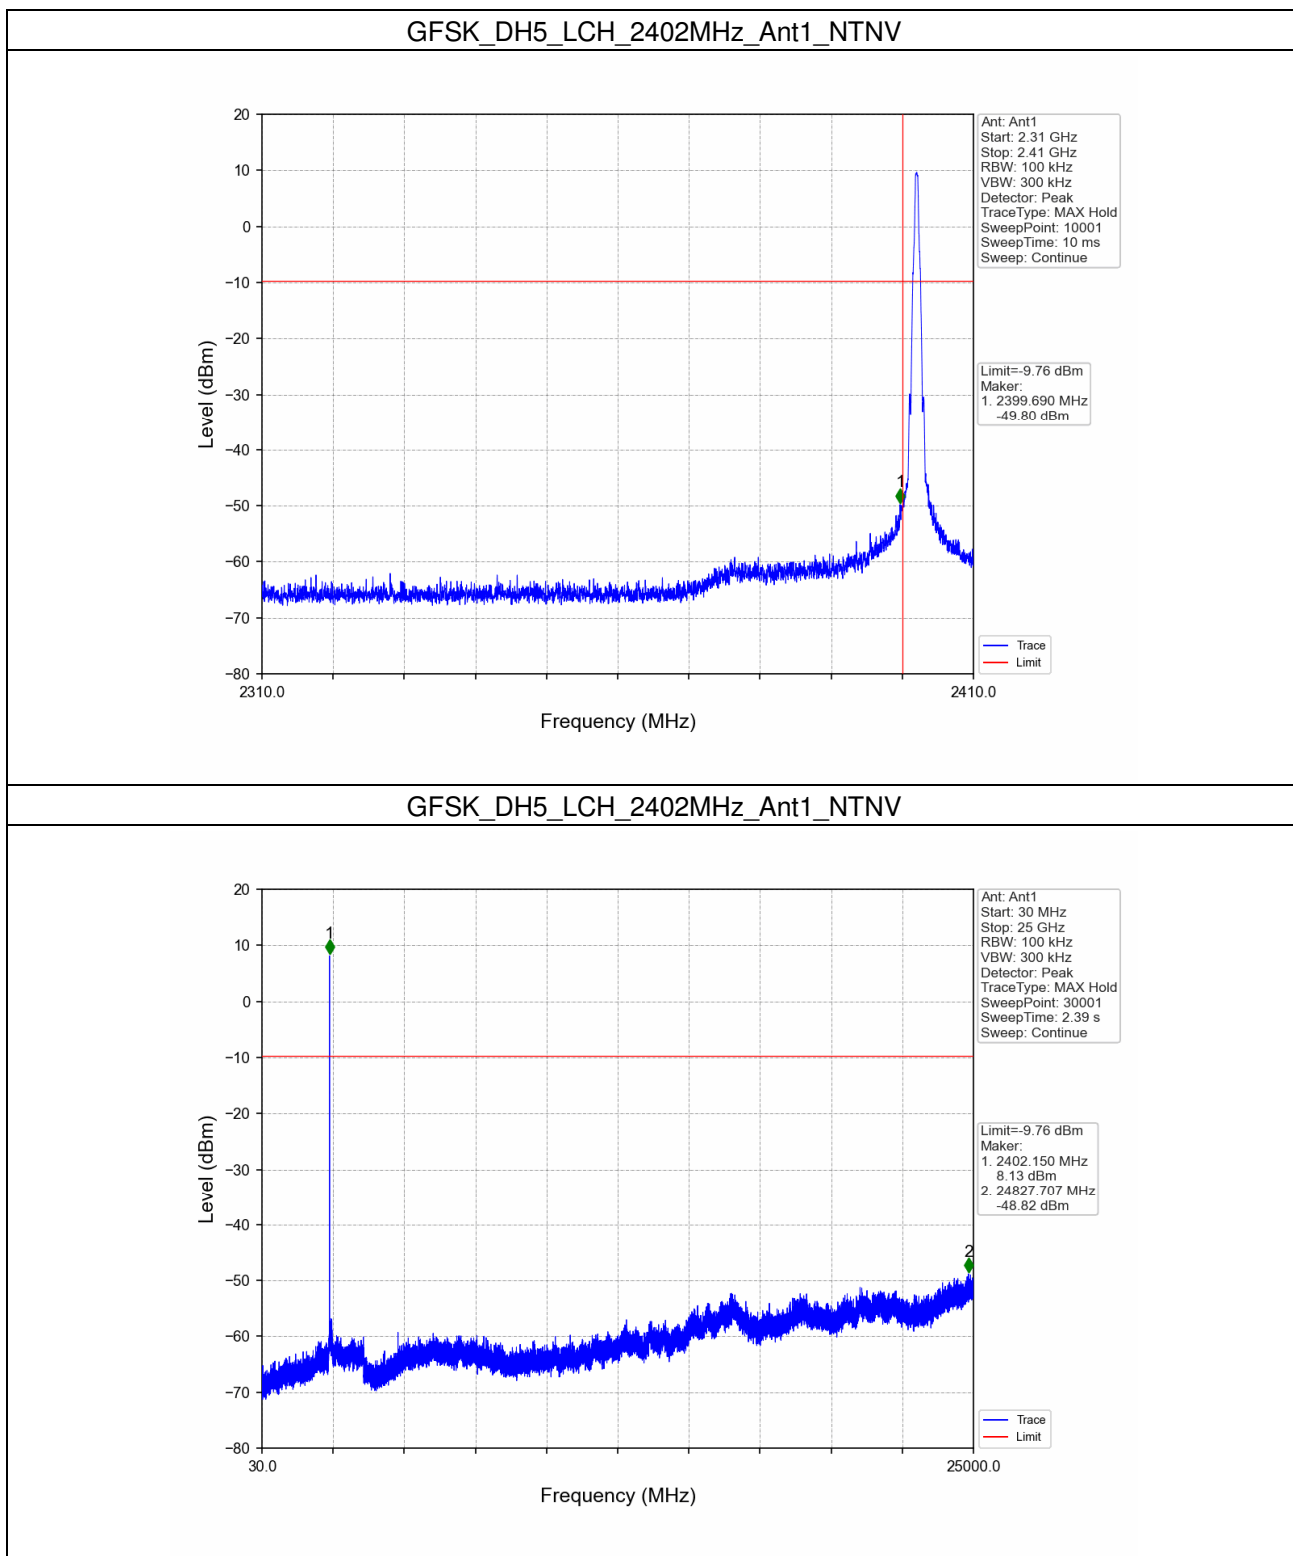


GFSK_DH5_MCH_2441MHz_Ant1_NTNV

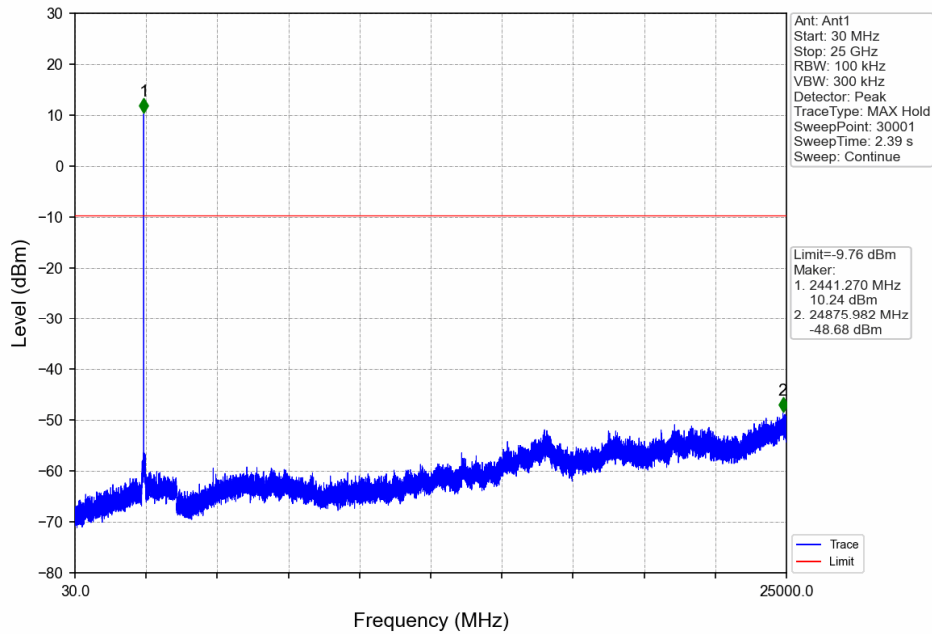


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

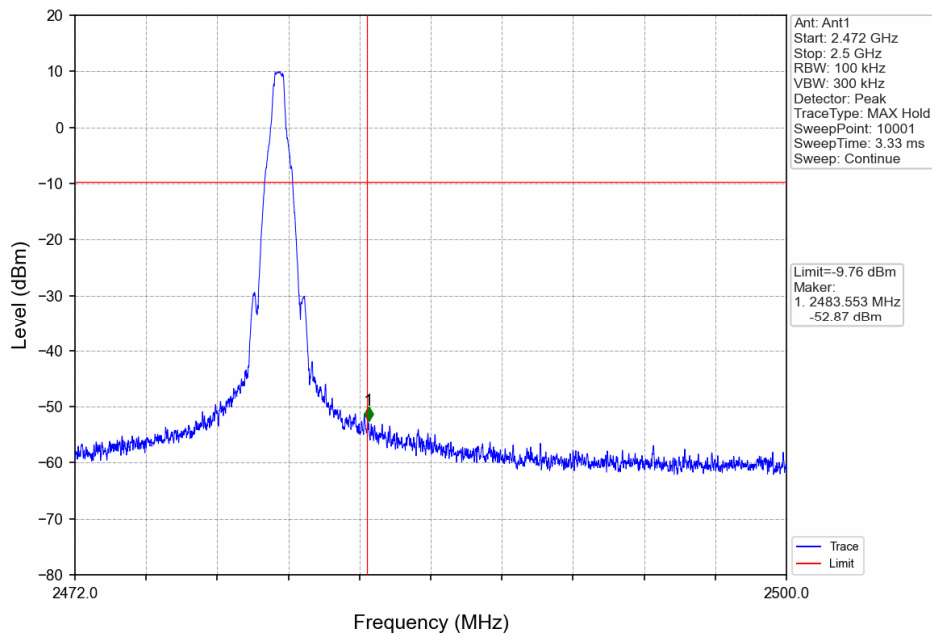


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

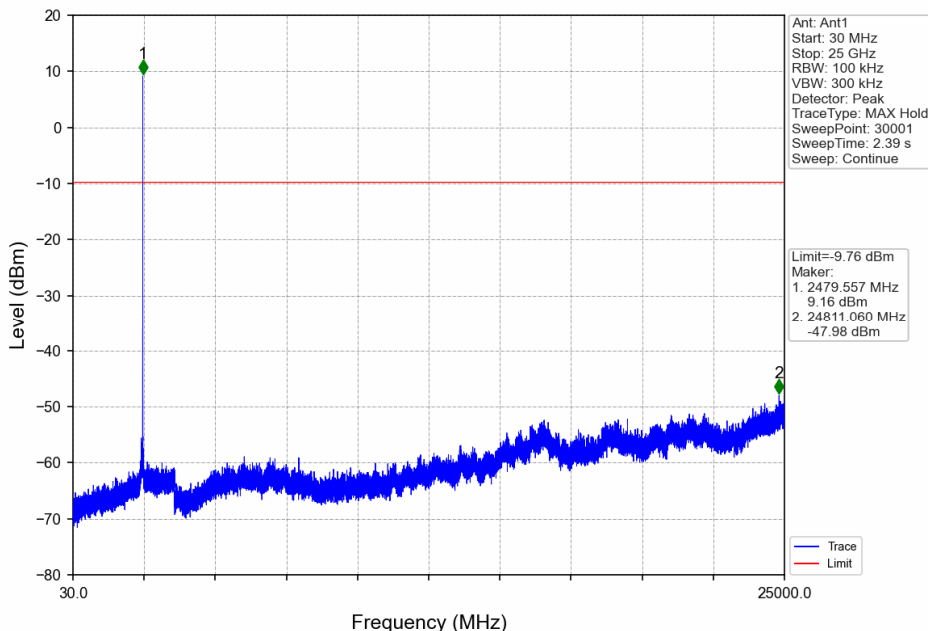


GFSK_DH5_HOPP_Ant1_NTNV

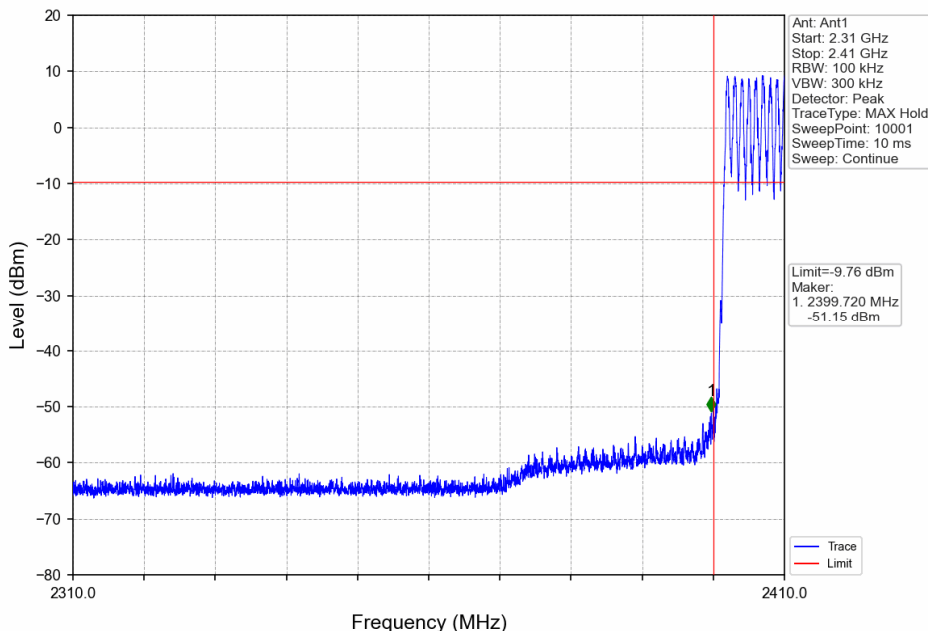


GFSK_DH5_HOPP_Ant1_NTNV

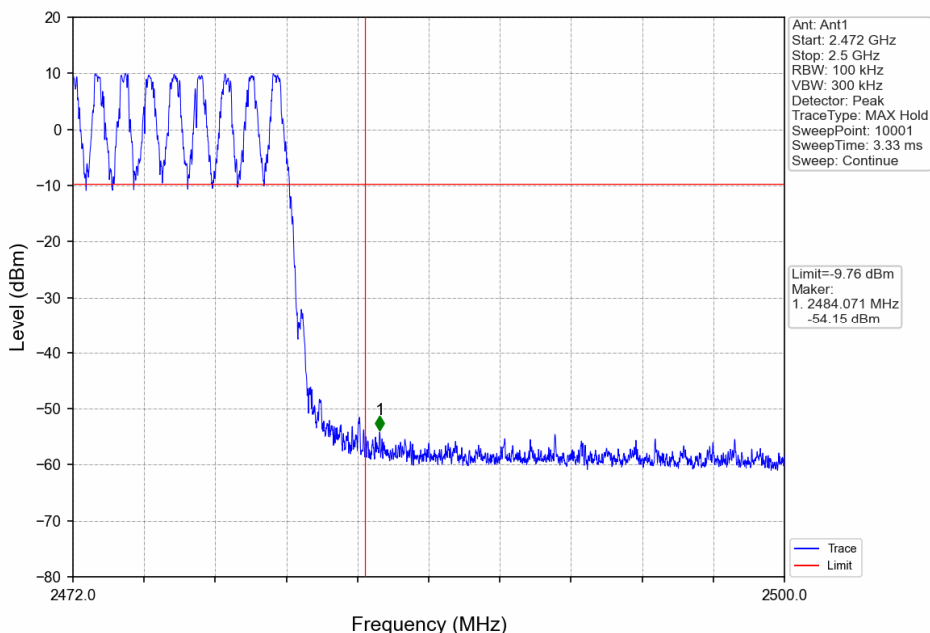


Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

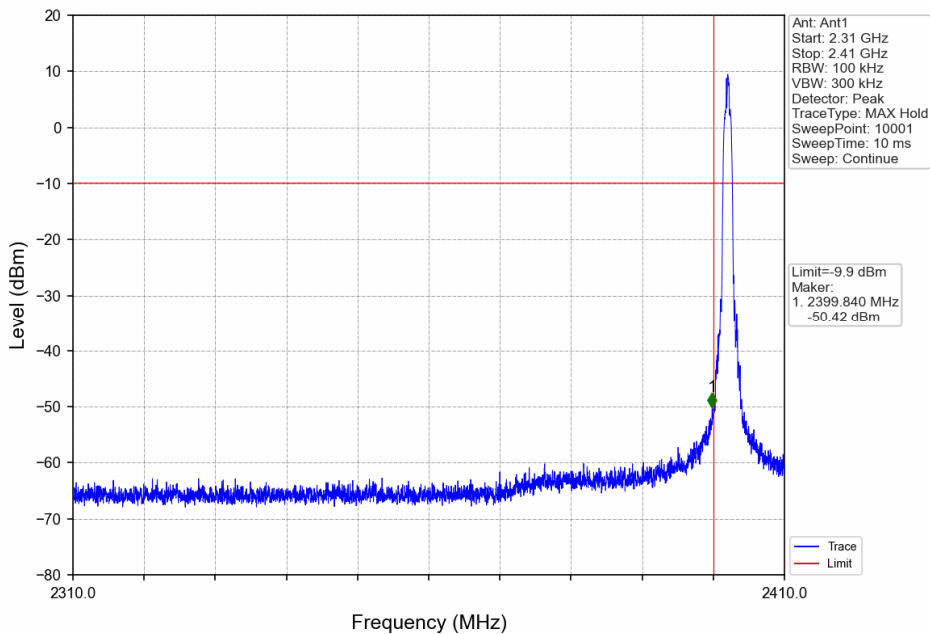

Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

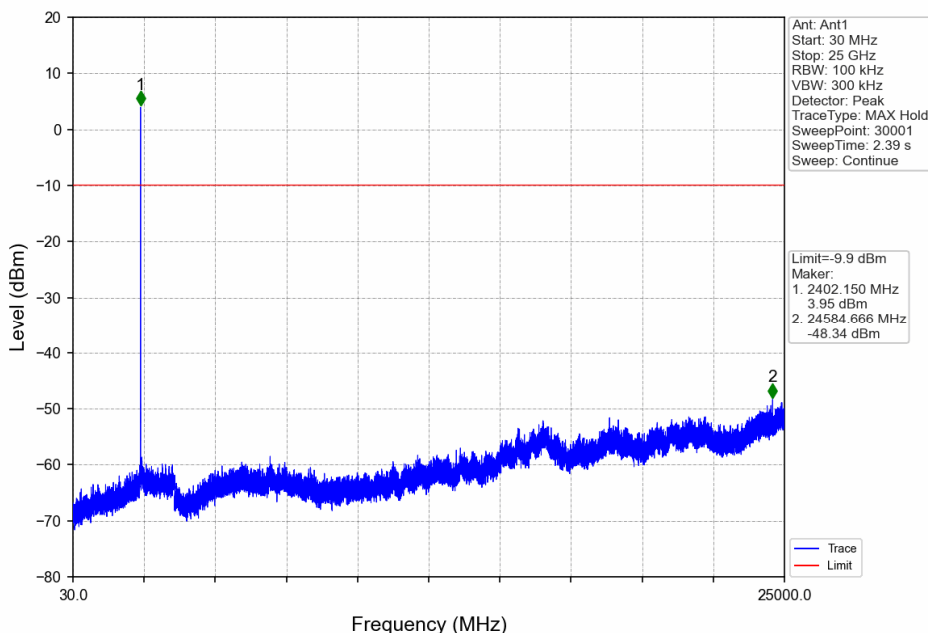


Pi/4DQPSK_2DH5_MCH_2441MHz_Ant1_NTNV

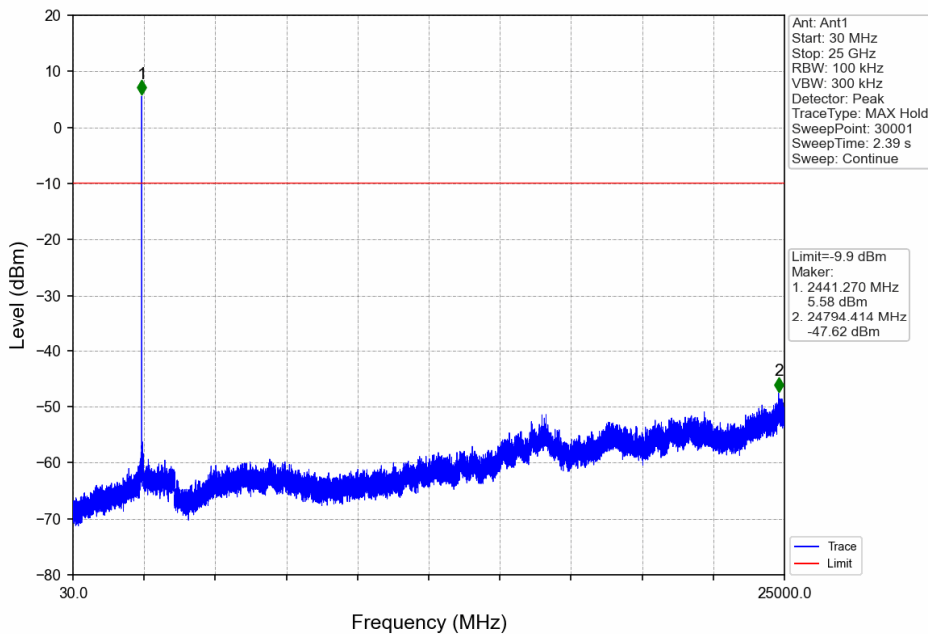


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.


Pi/4DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

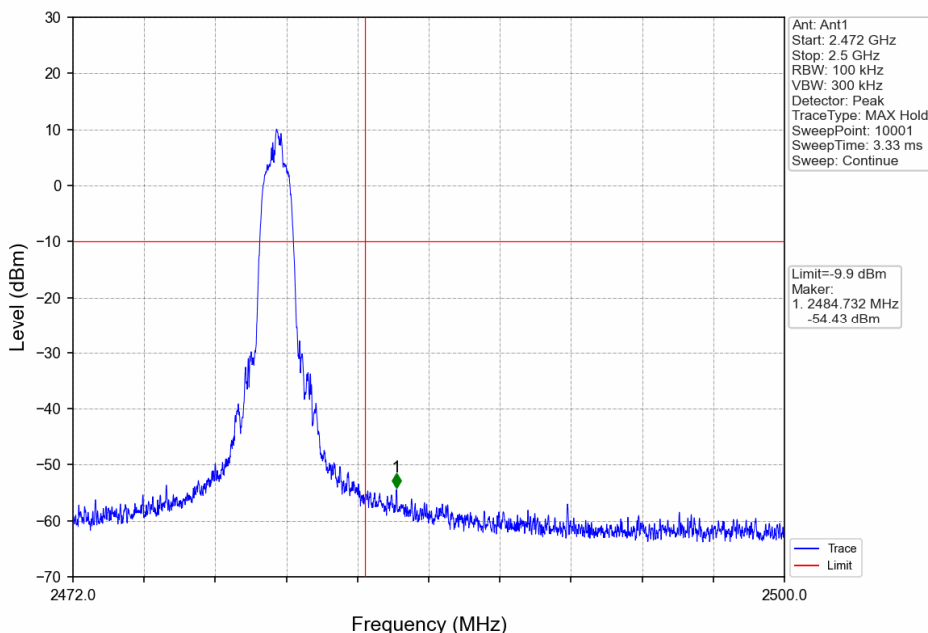


Pi/4DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

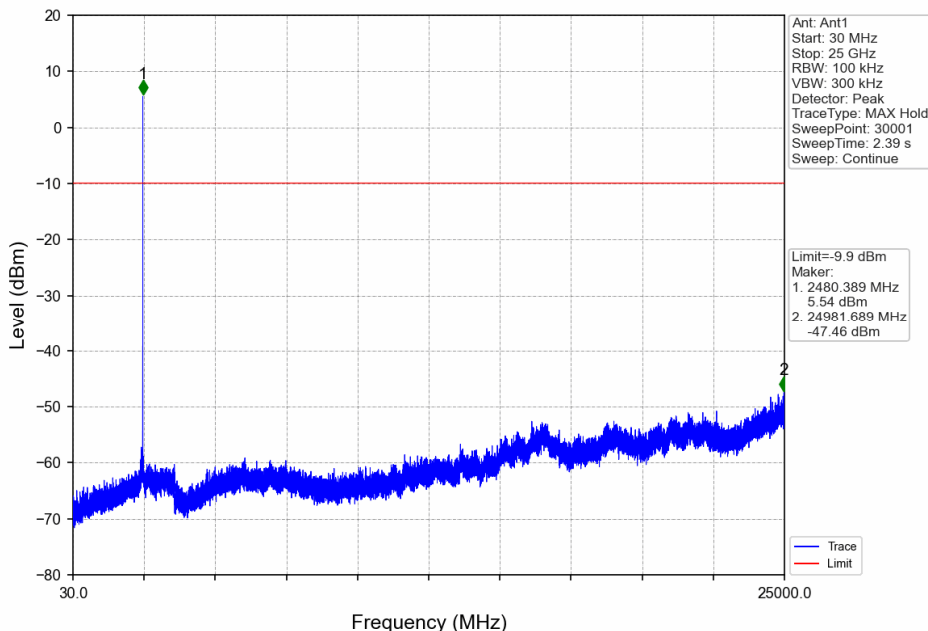


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

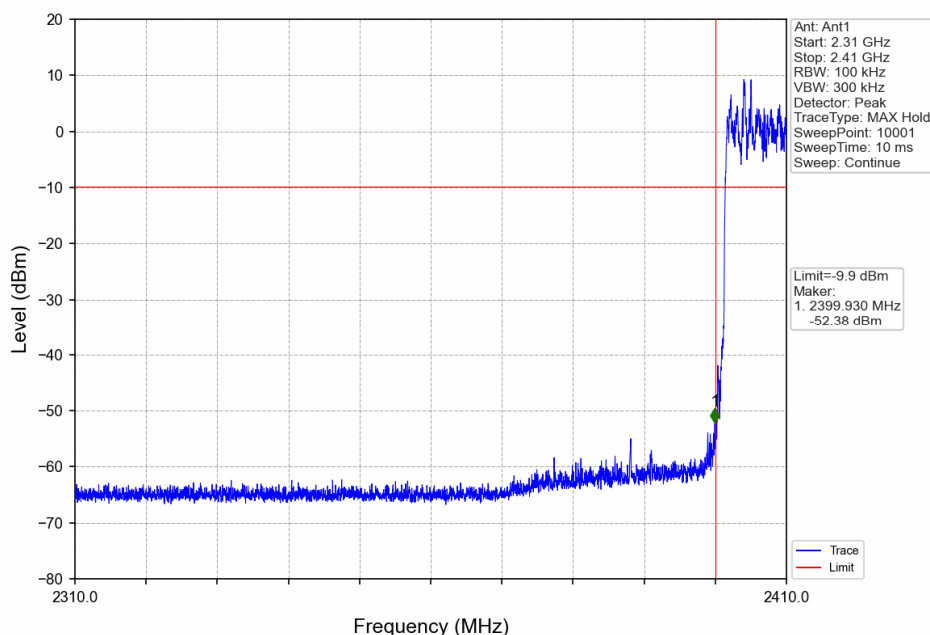


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

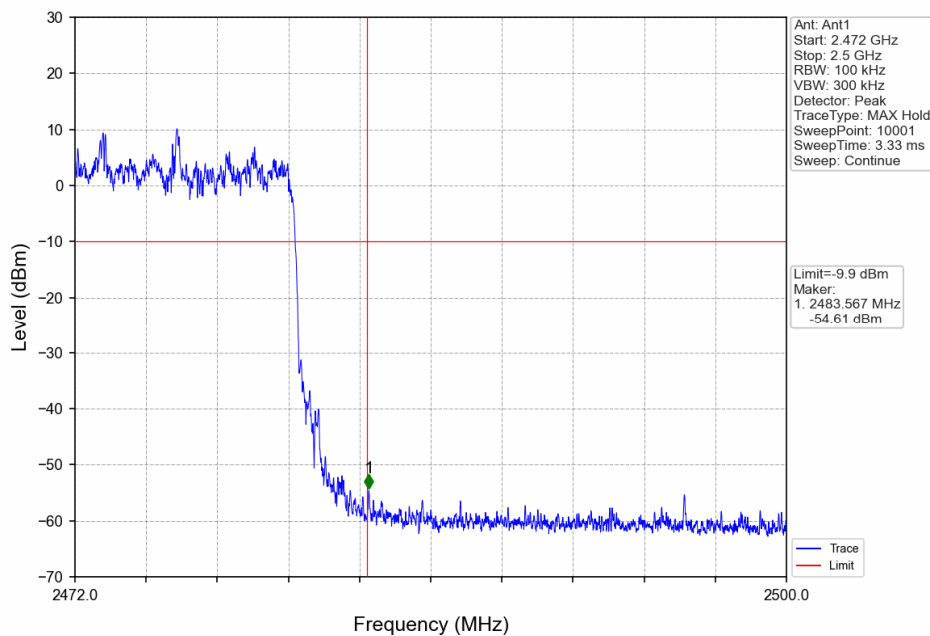


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

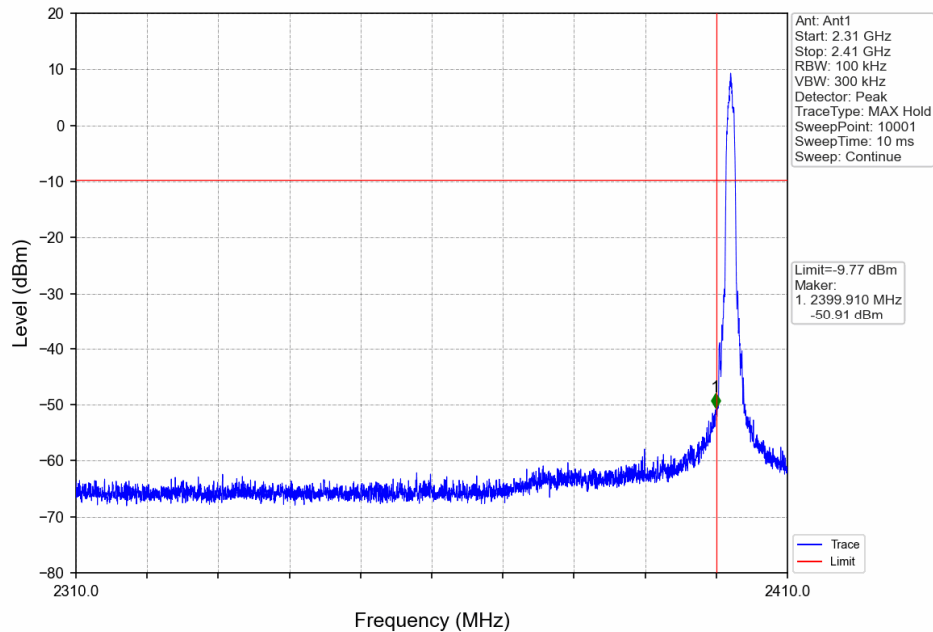


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

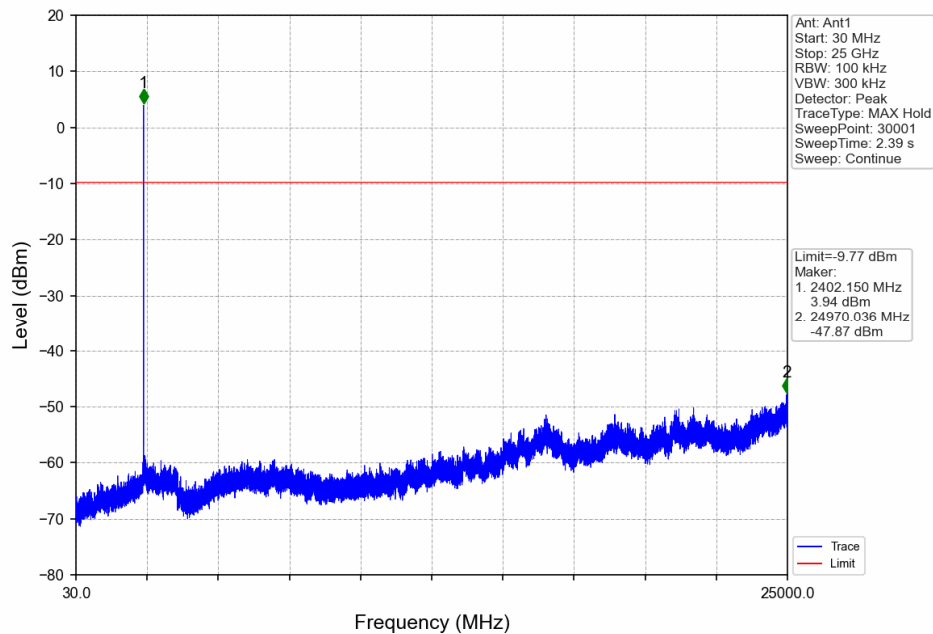


8DPSK_3DH5_MCH_2441MHz_Ant1_NTNV

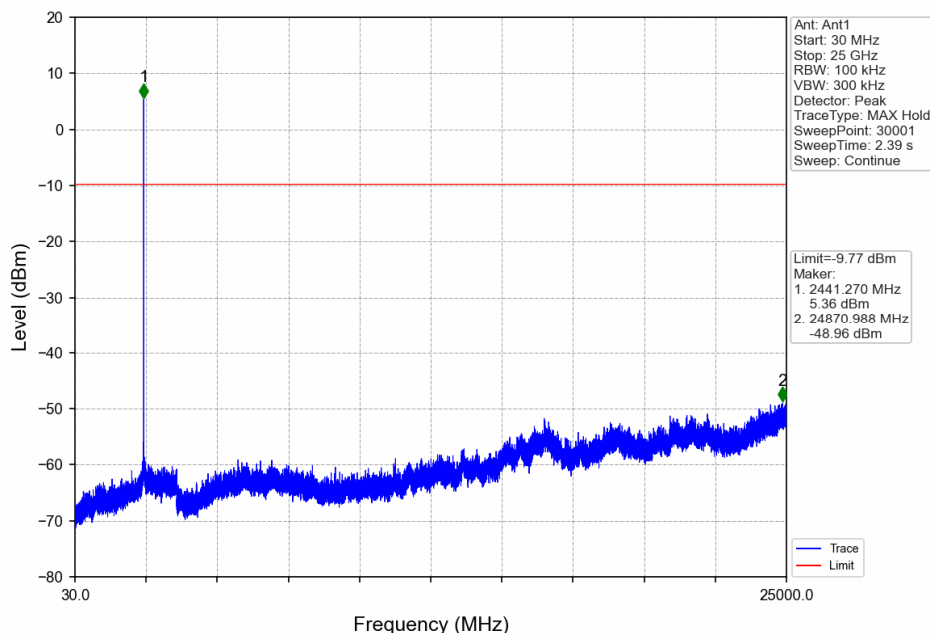


8DPSK_3DH5_HCH_2480MHz_Ant1_NTNV

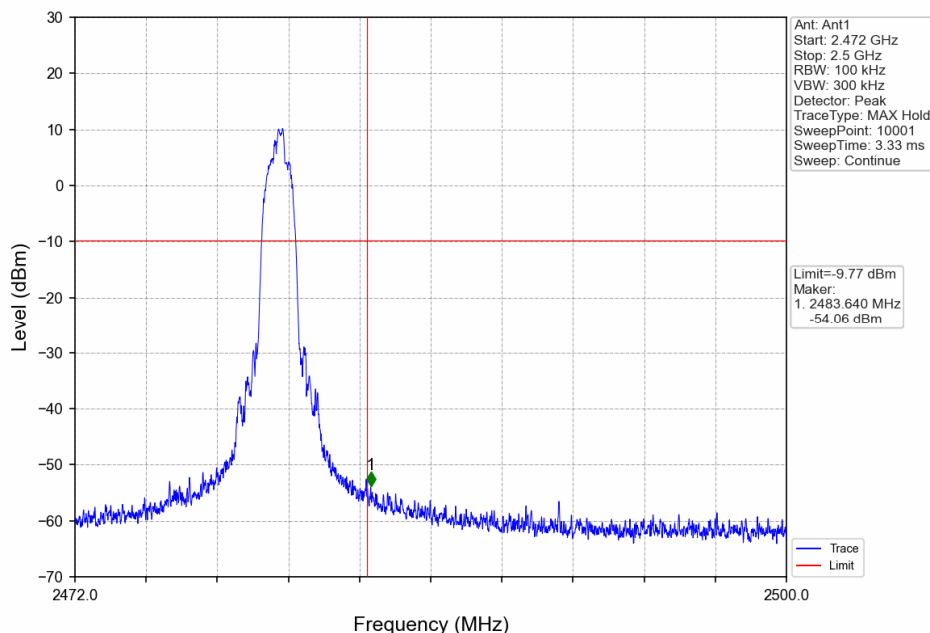


8DPSK_3DH5_HCH_2480MHz_Ant1_NTNV

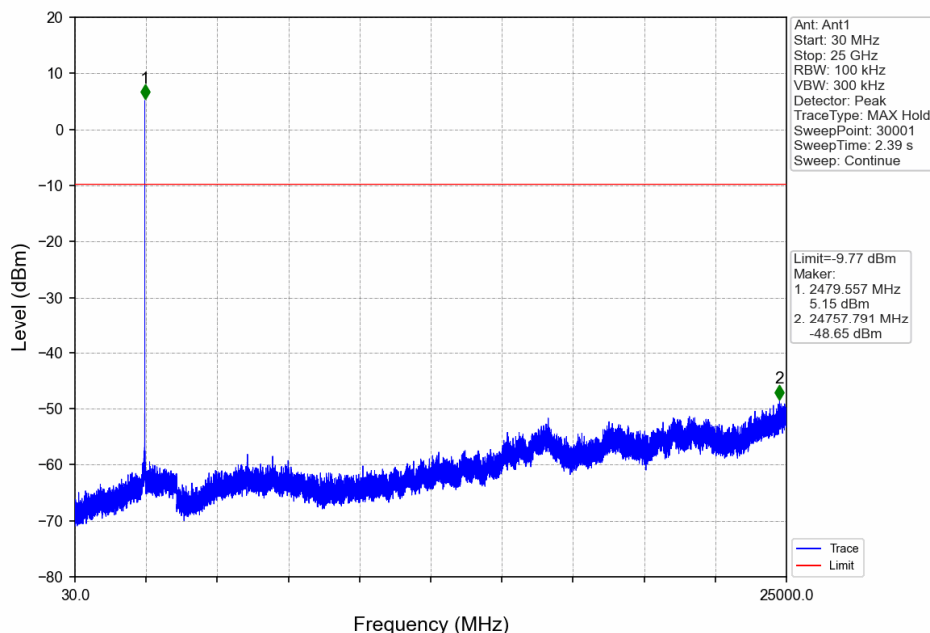

8DPSK_3DH5_HOPP_Ant1_NTNV

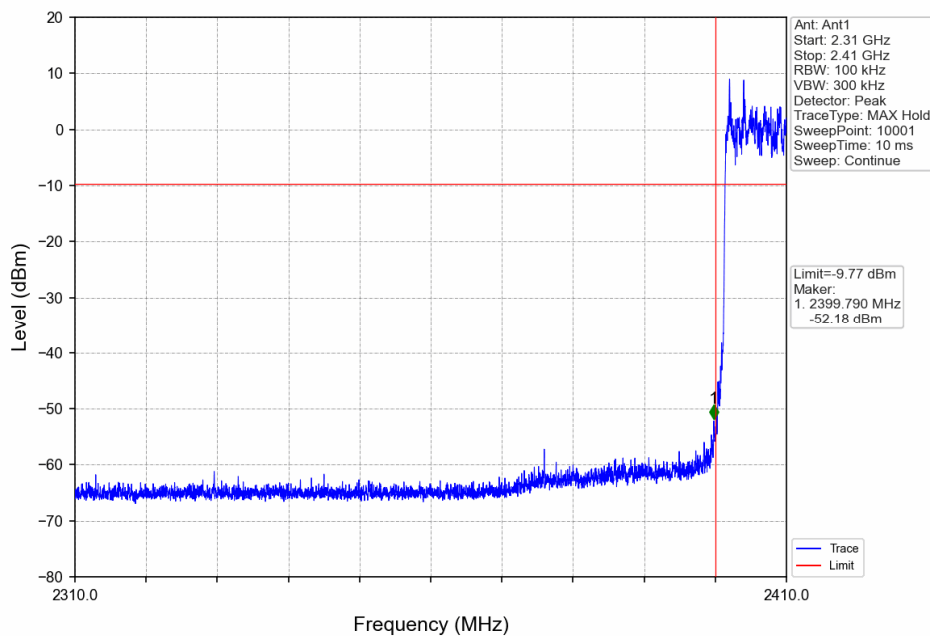

8DPSK_3DH5_HOPP_Ant1_NTNV

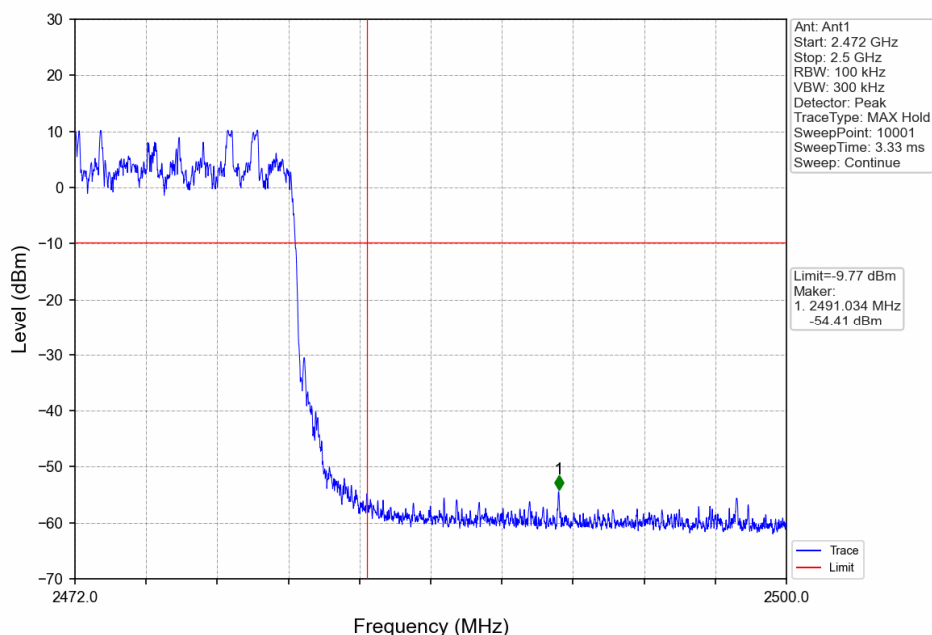

Right earbud


1. Bandwidth

1.1 OBW


1.1.1 Test Result

Mode	TX Type	Frequency (MHz)	Packet Type	Ant	99% Occupied Bandwidth (MHz)	Verdict
					Result	
GFSK	SISO	2402	DH5	1	0.940	Pass
		2441	DH5	1	0.924	Pass
		2480	DH5	1	0.935	Pass
Pi/4DQPSK	SISO	2402	2DH5	1	1.122	Pass
		2441	2DH5	1	1.123	Pass
		2480	2DH5	1	1.126	Pass
8DPSK	SISO	2402	3DH5	1	1.140	Pass
		2441	3DH5	1	1.137	Pass
		2480	3DH5	1	1.137	Pass


1.1.2 Test Graph

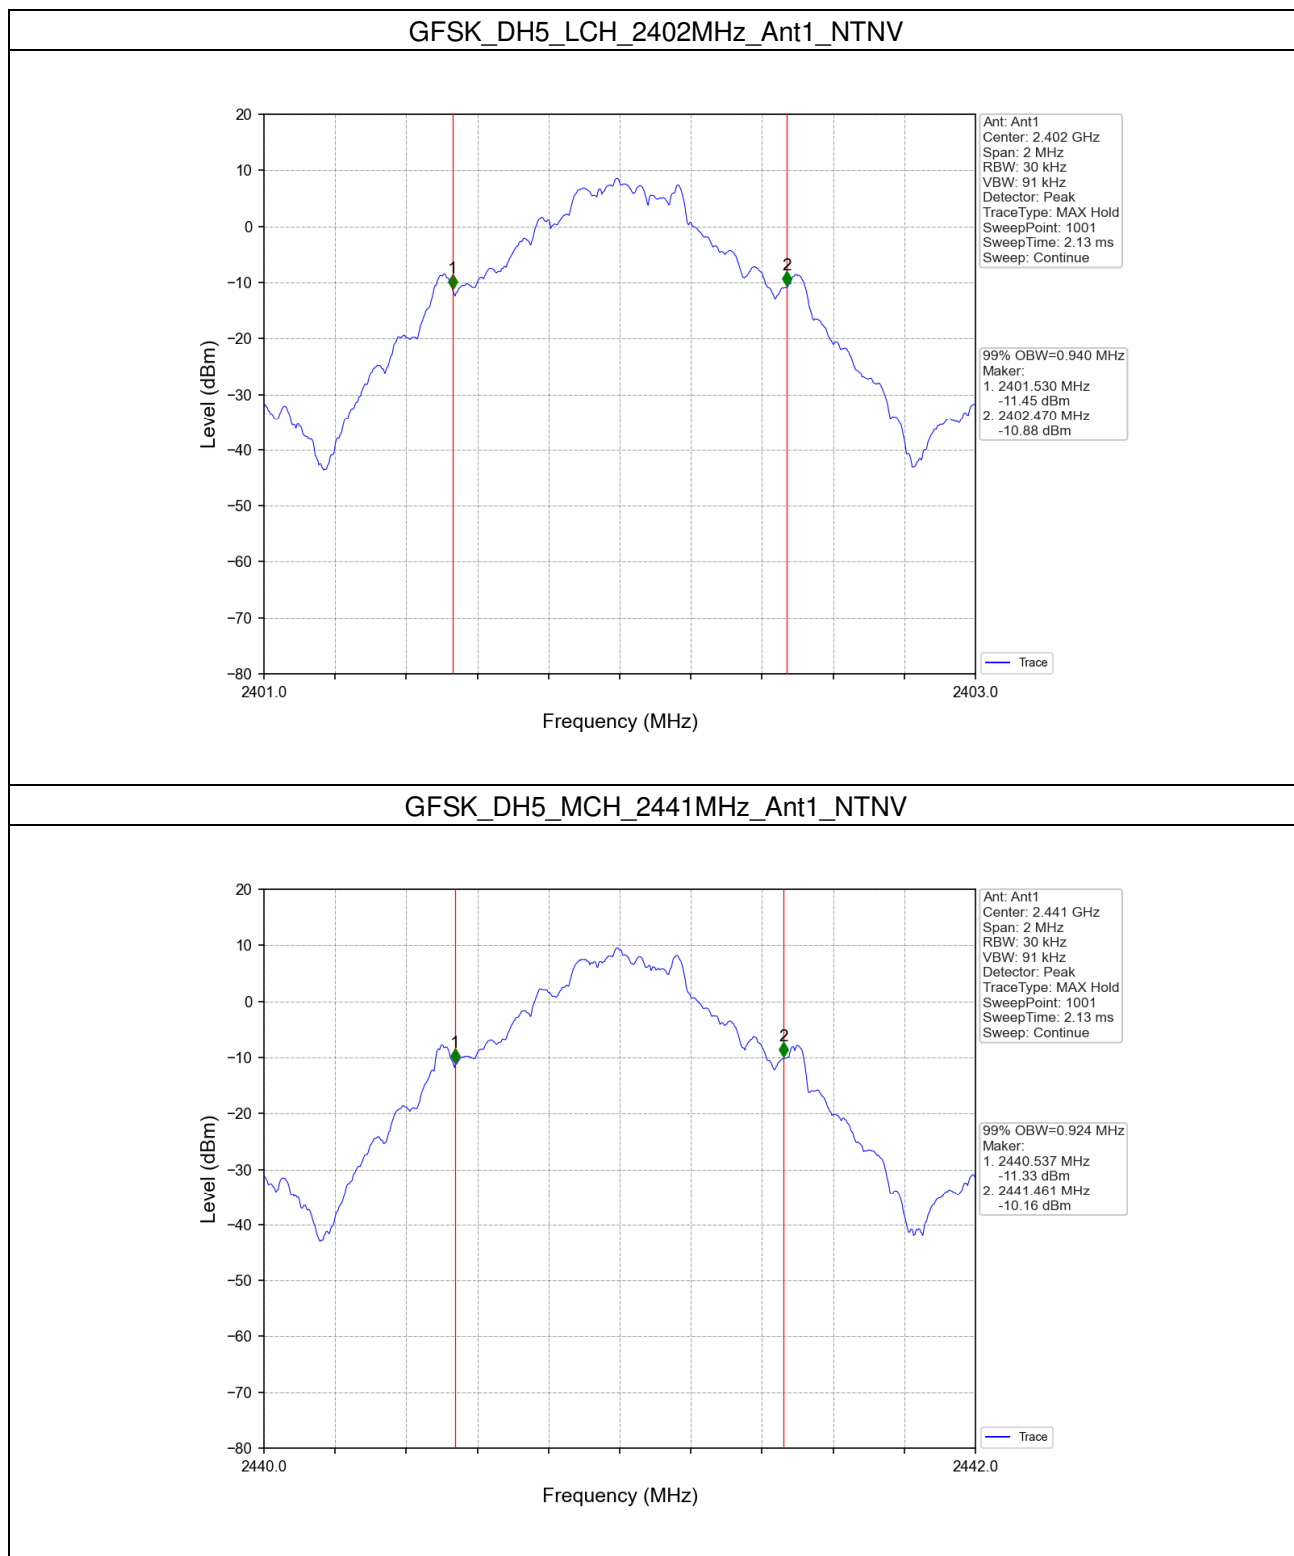


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

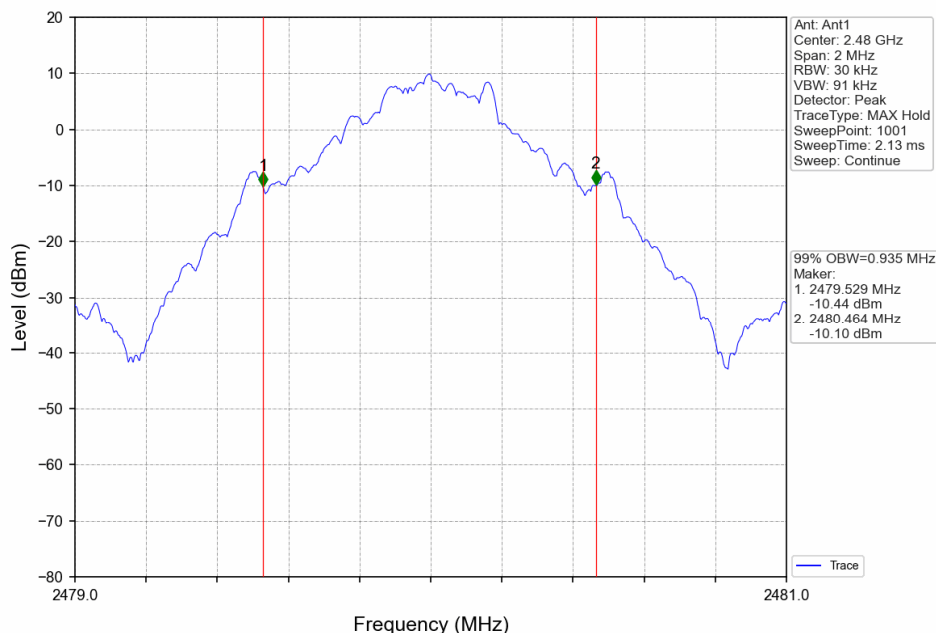


Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

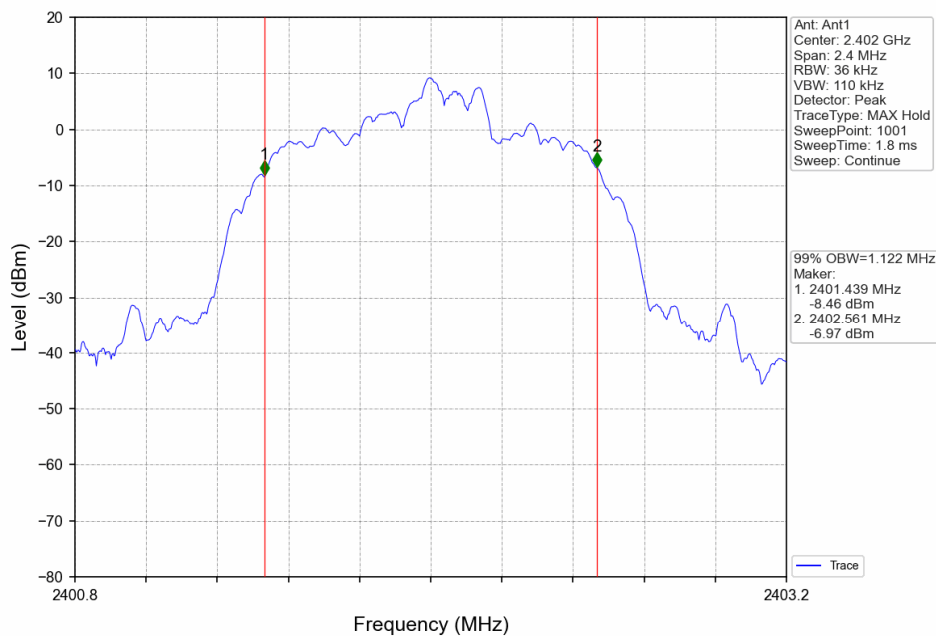


Pi/4DQPSK_2DH5_MCH_2441MHz_Ant1_NTNV

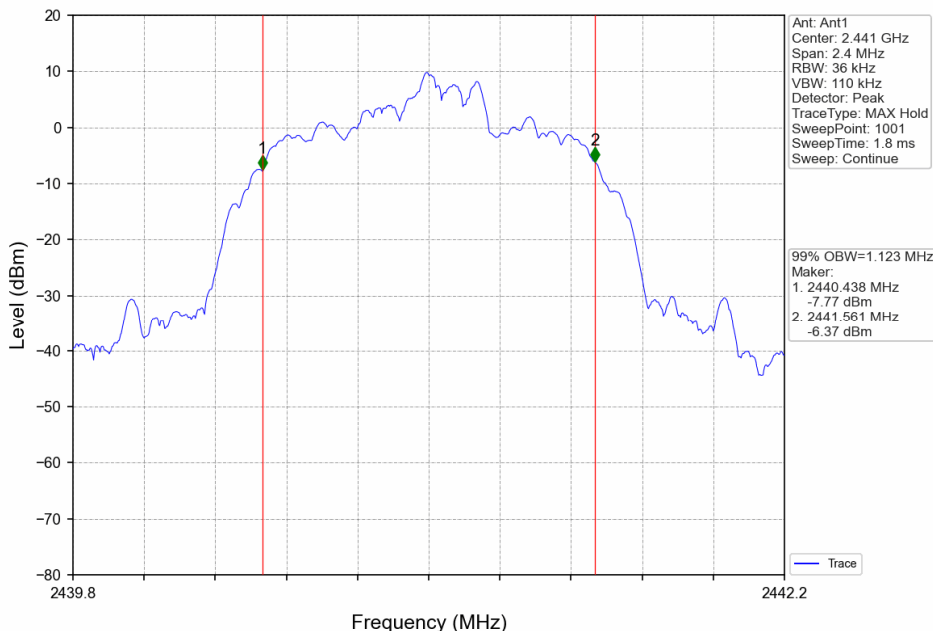


Pi/4DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

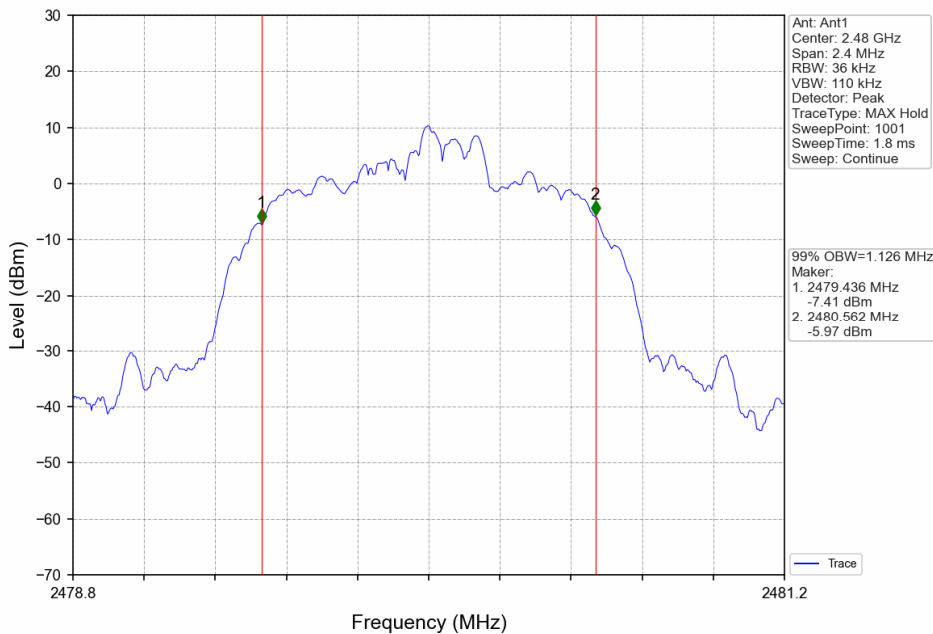

8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

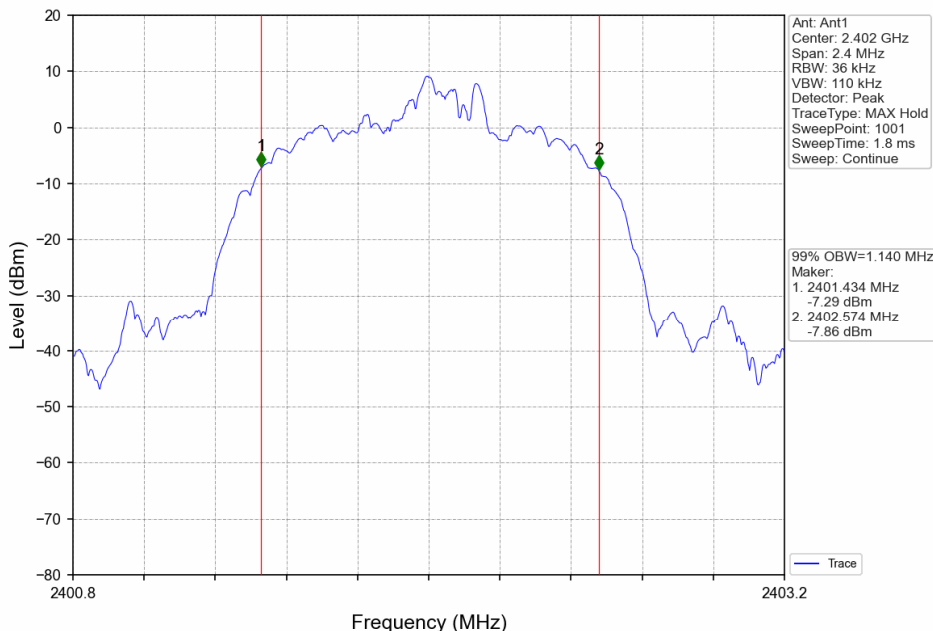


8DPSK_3DH5_MCH_2441MHz_Ant1_NTNV

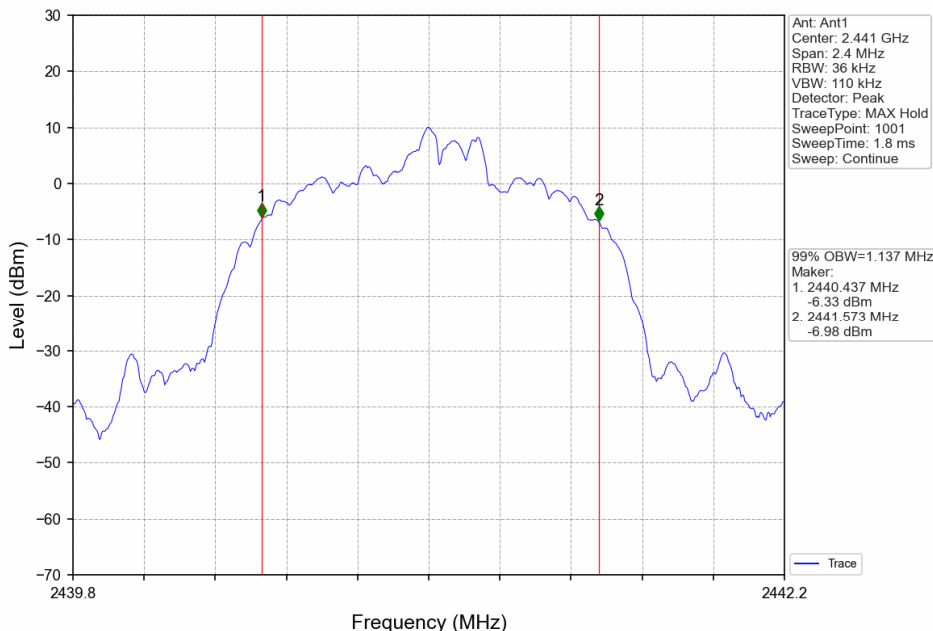

Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

8DPSK_3DH5_HCH_2480MHz_Ant1_NTNV

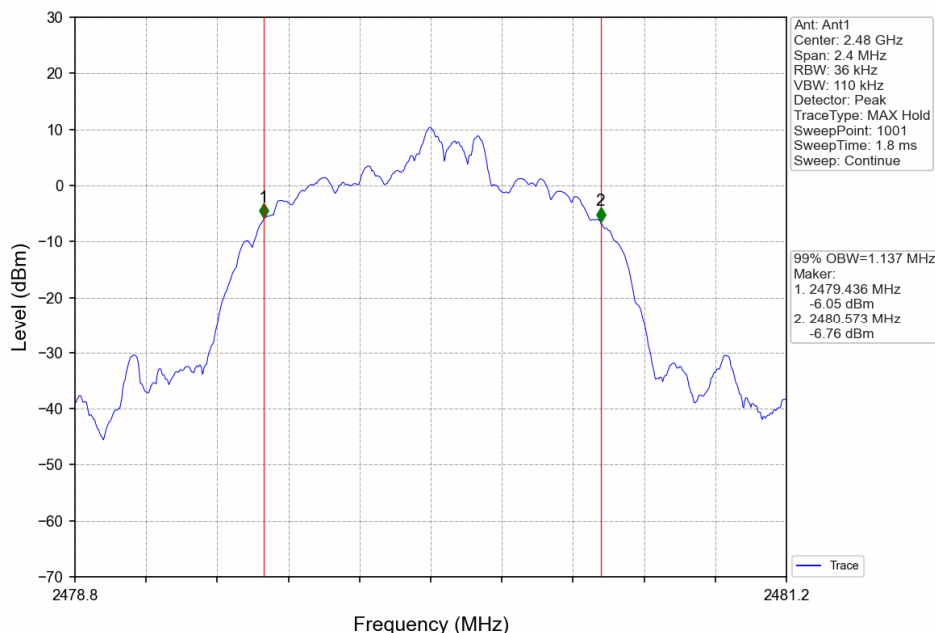


1.2 20dB BW


1.2.1 Test Result

Mode	TX Type	Frequency (MHz)	Packet Type	Ant	20dB Bandwidth (MHz)	Verdict
					Result	
GFSK	SISO	2402	DH5	1	1.022	Pass
		2441	DH5	1	1.043	Pass
		2480	DH5	1	1.043	Pass
Pi/4DQPSK	SISO	2402	2DH5	1	1.200	Pass
		2441	2DH5	1	1.196	Pass
		2480	2DH5	1	1.200	Pass
8DPSK	SISO	2402	3DH5	1	1.216	Pass
		2441	3DH5	1	1.211	Pass
		2480	3DH5	1	1.216	Pass


1.2.2 Test Graph

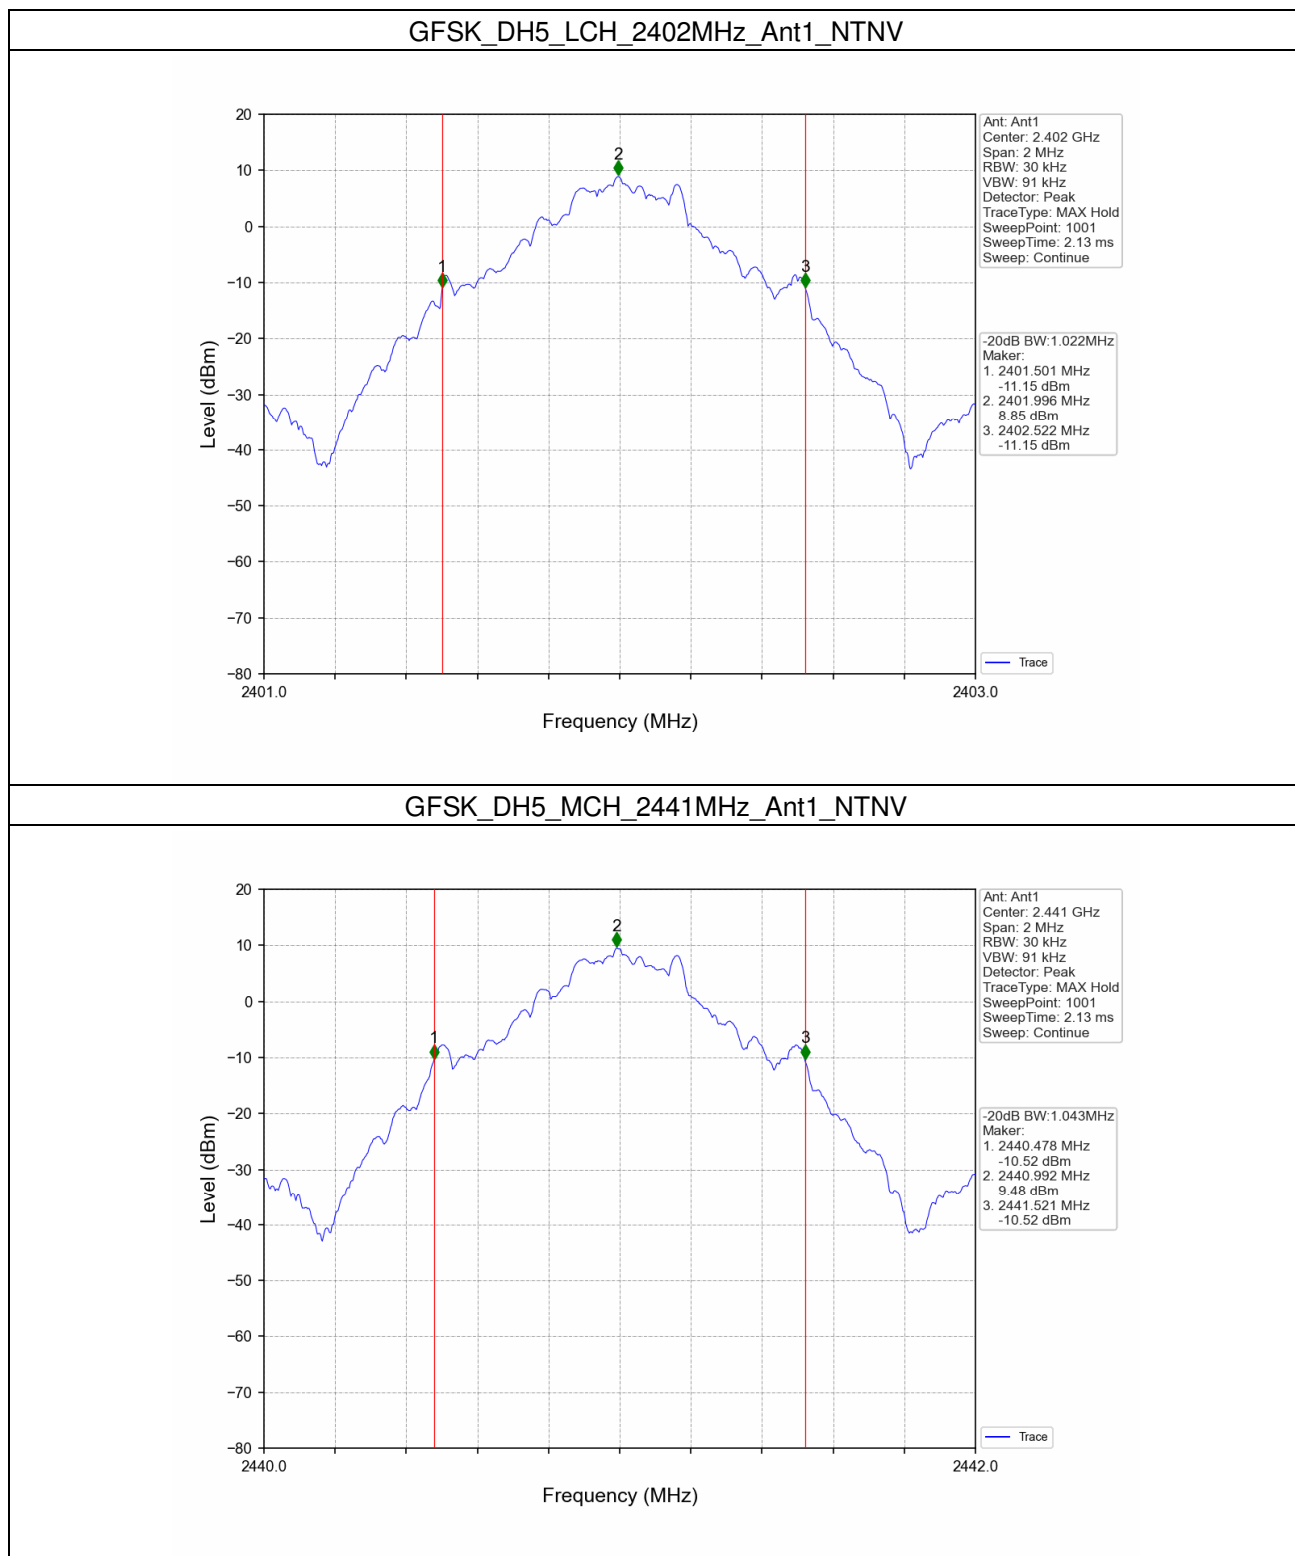


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

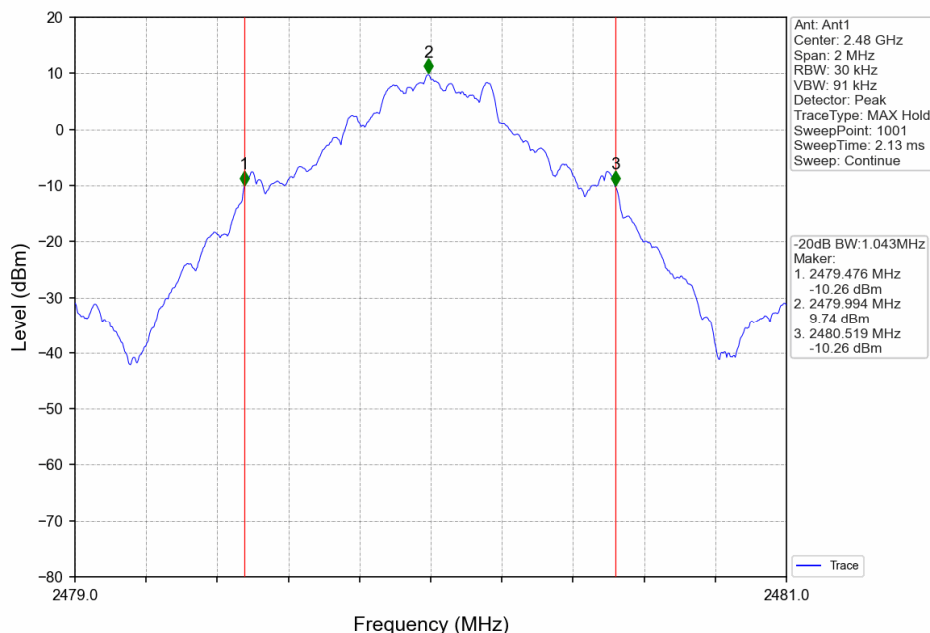


Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

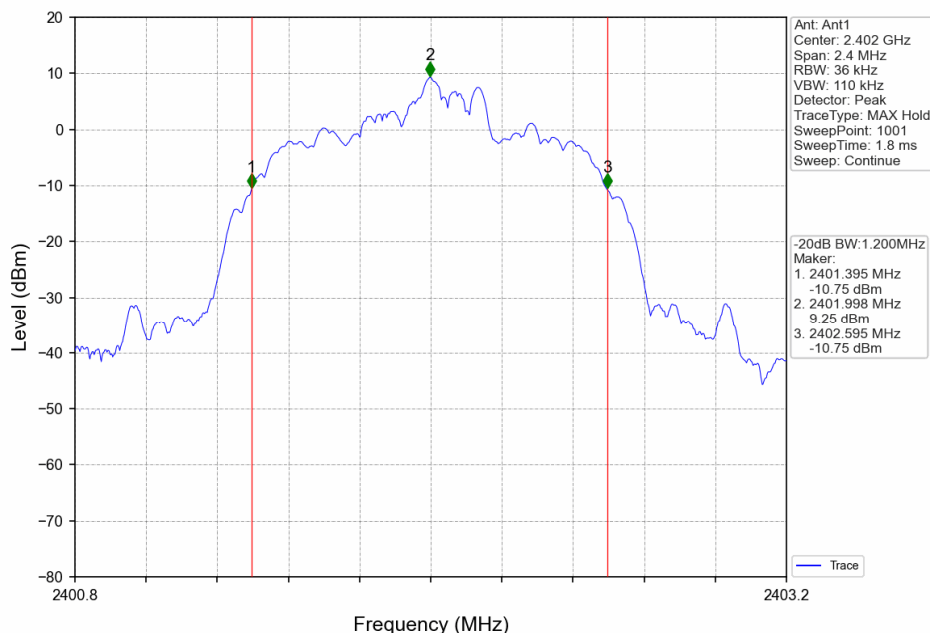


Pi/4DQPSK_2DH5_MCH_2441MHz_Ant1_NTNV

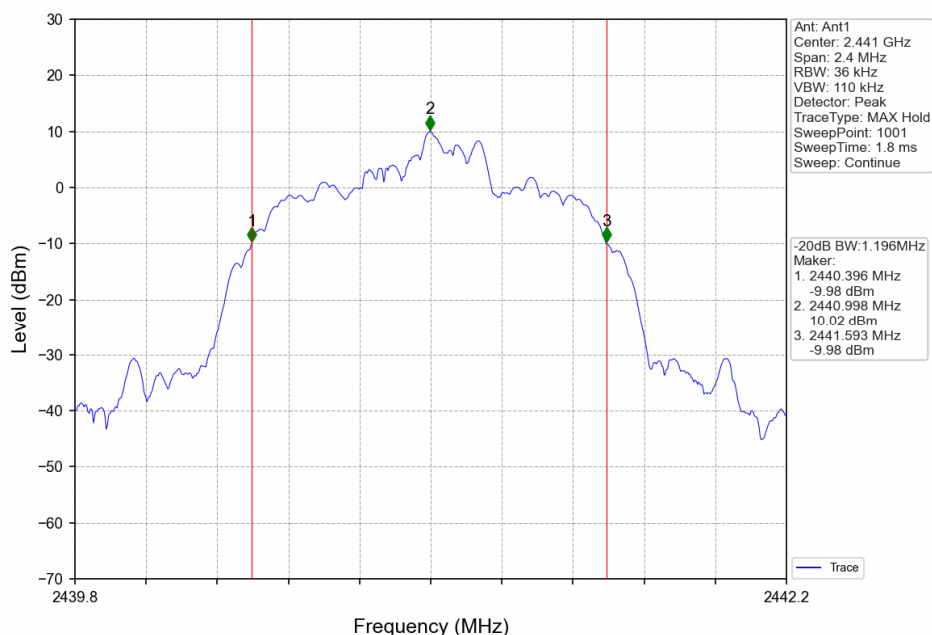


Pi/4DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

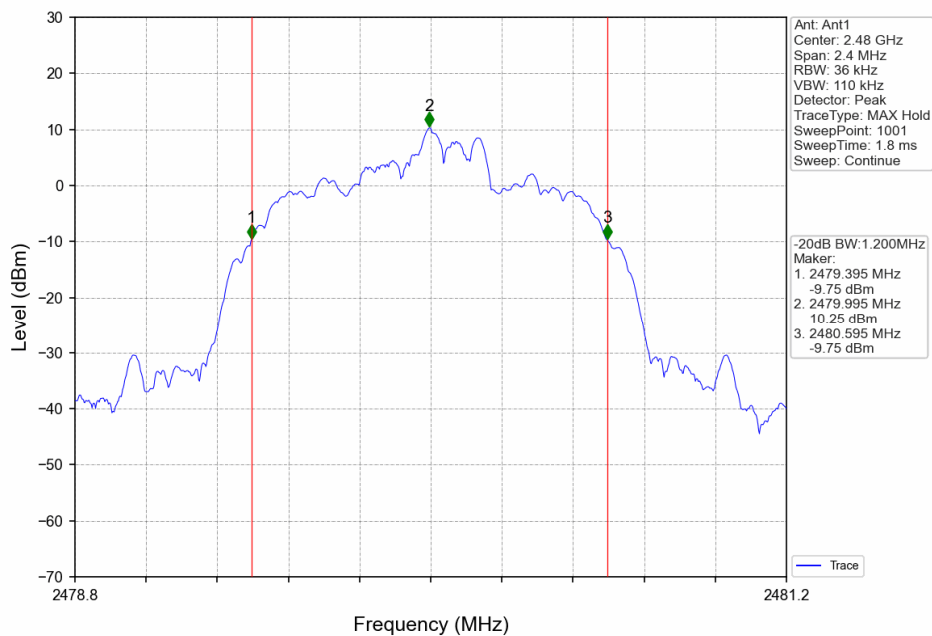


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

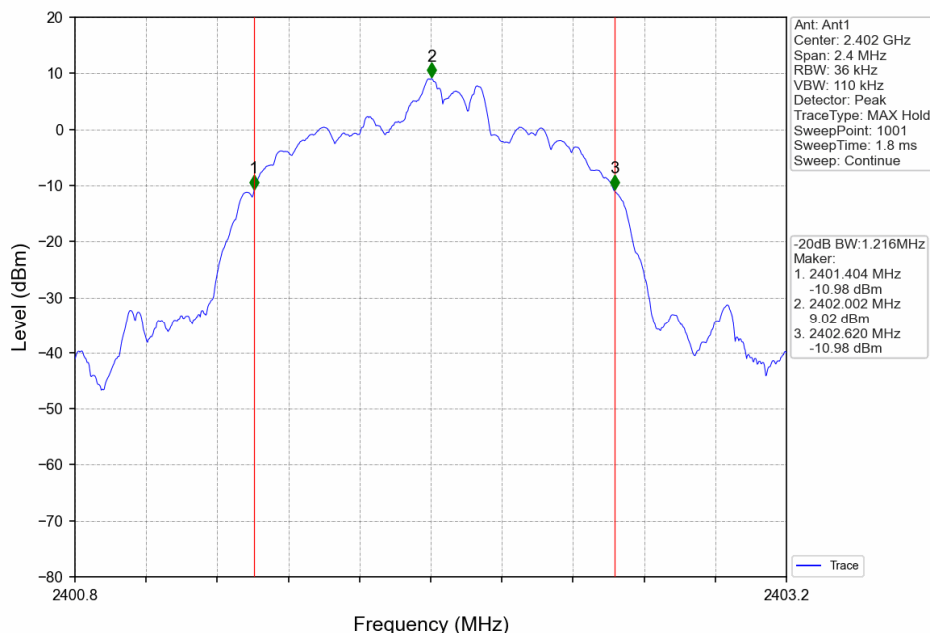

8DPSK_3DH5_MCH_2441MHz_Ant1_NTNV

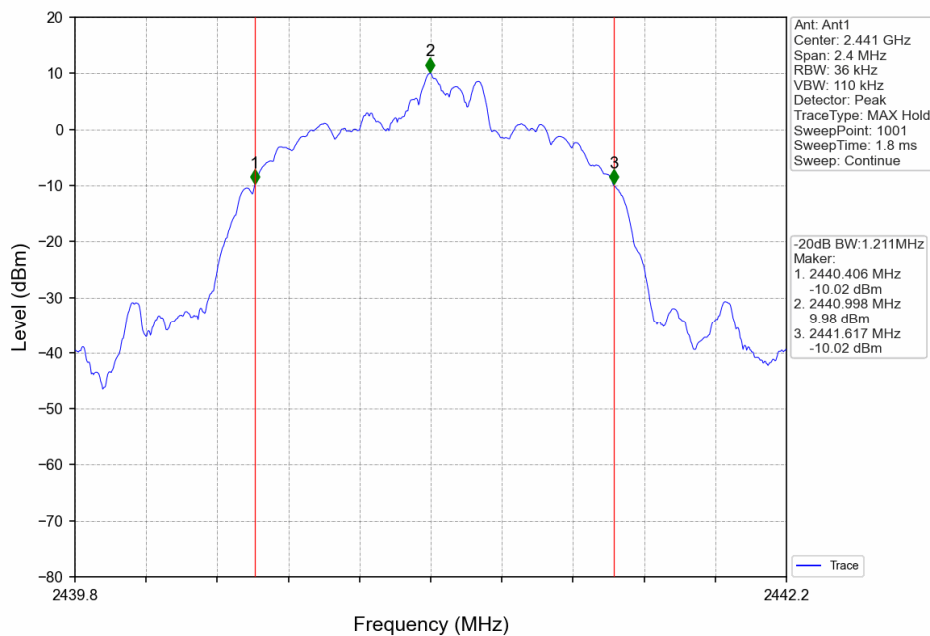

8DPSK_3DH5_HCH_2480MHz_Ant1_NTNV

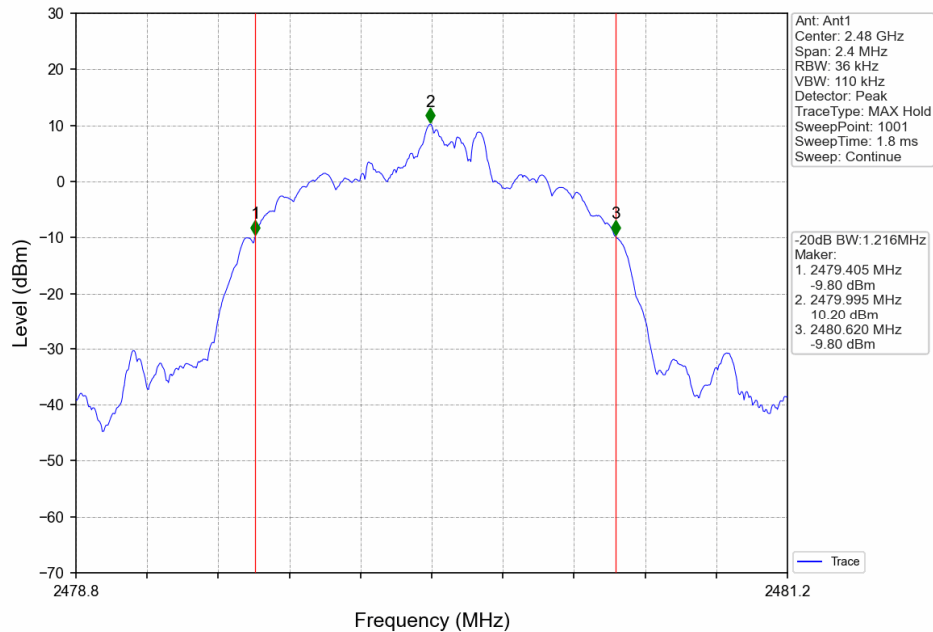

Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

2. Maximum Conducted Output Power

2.1 Power

2.1.1 Test Result

Mode	TX Type	Frequency (MHz)	Packet Type	Maximum Peak Conducted Output Power (dBm)		Verdict
				Ant1	Limit	
GFSK	SISO	2402	DH5	10.04	<=20.97	Pass
		2441	DH5	10.81	<=20.97	Pass
		2480	DH5	11.06	<=20.97	Pass
Pi/4DQPSK	SISO	2402	2DH5	9.99	<=20.97	Pass
		2441	2DH5	10.76	<=20.97	Pass
		2480	2DH5	11.04	<=20.97	Pass
8DPSK	SISO	2402	3DH5	10.00	<=20.97	Pass
		2441	3DH5	10.77	<=20.97	Pass
		2480	3DH5	11.05	<=20.97	Pass

3. Carrier Frequency Separation

3.1 Ant1

3.1.1 Test Result

Ant1							
Mode	TX Type	Frequency (MHz)	Packet Type	Channel Separation (MHz)	20dB Bandwidth (MHz)	Limit (MHz)	Verdict
GFSK	SISO	HOPP	DH5	1.000	1.043	≥ 0.695	Pass
Pi/4DQPSK	SISO	HOPP	2DH5	0.985	1.200	≥ 0.8	Pass
8DPSK	SISO	HOPP	3DH5	0.995	1.216	≥ 0.811	Pass