



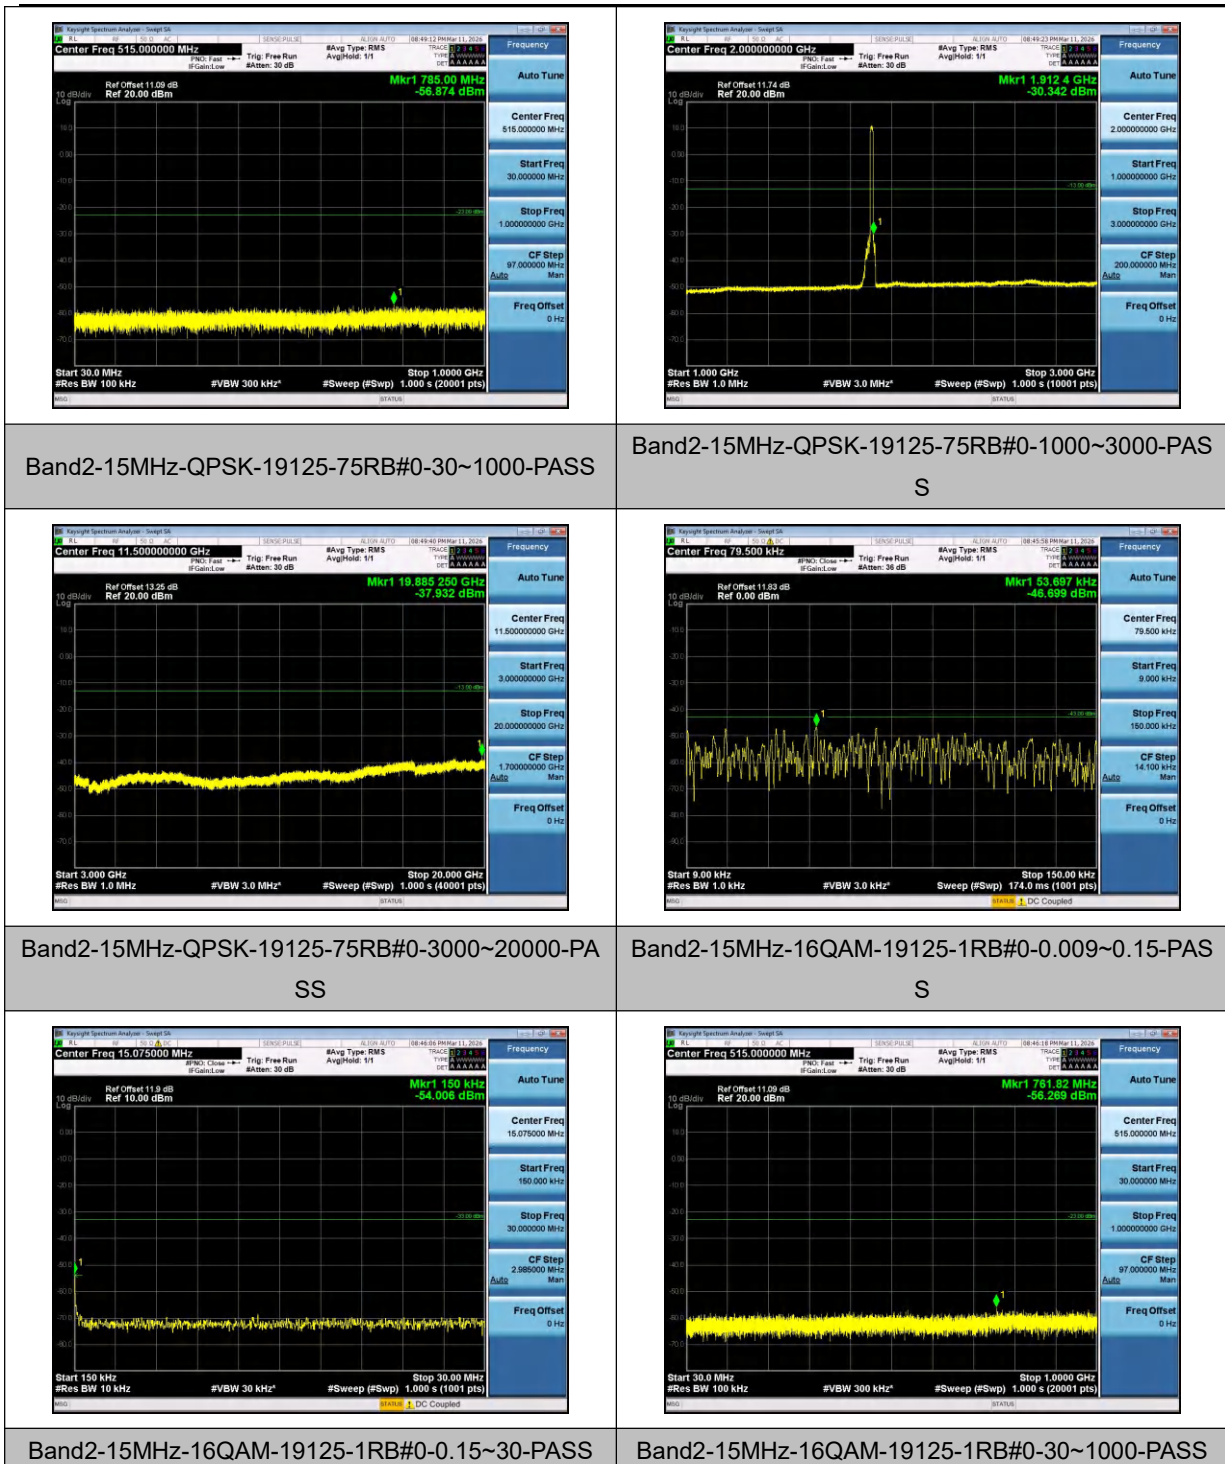
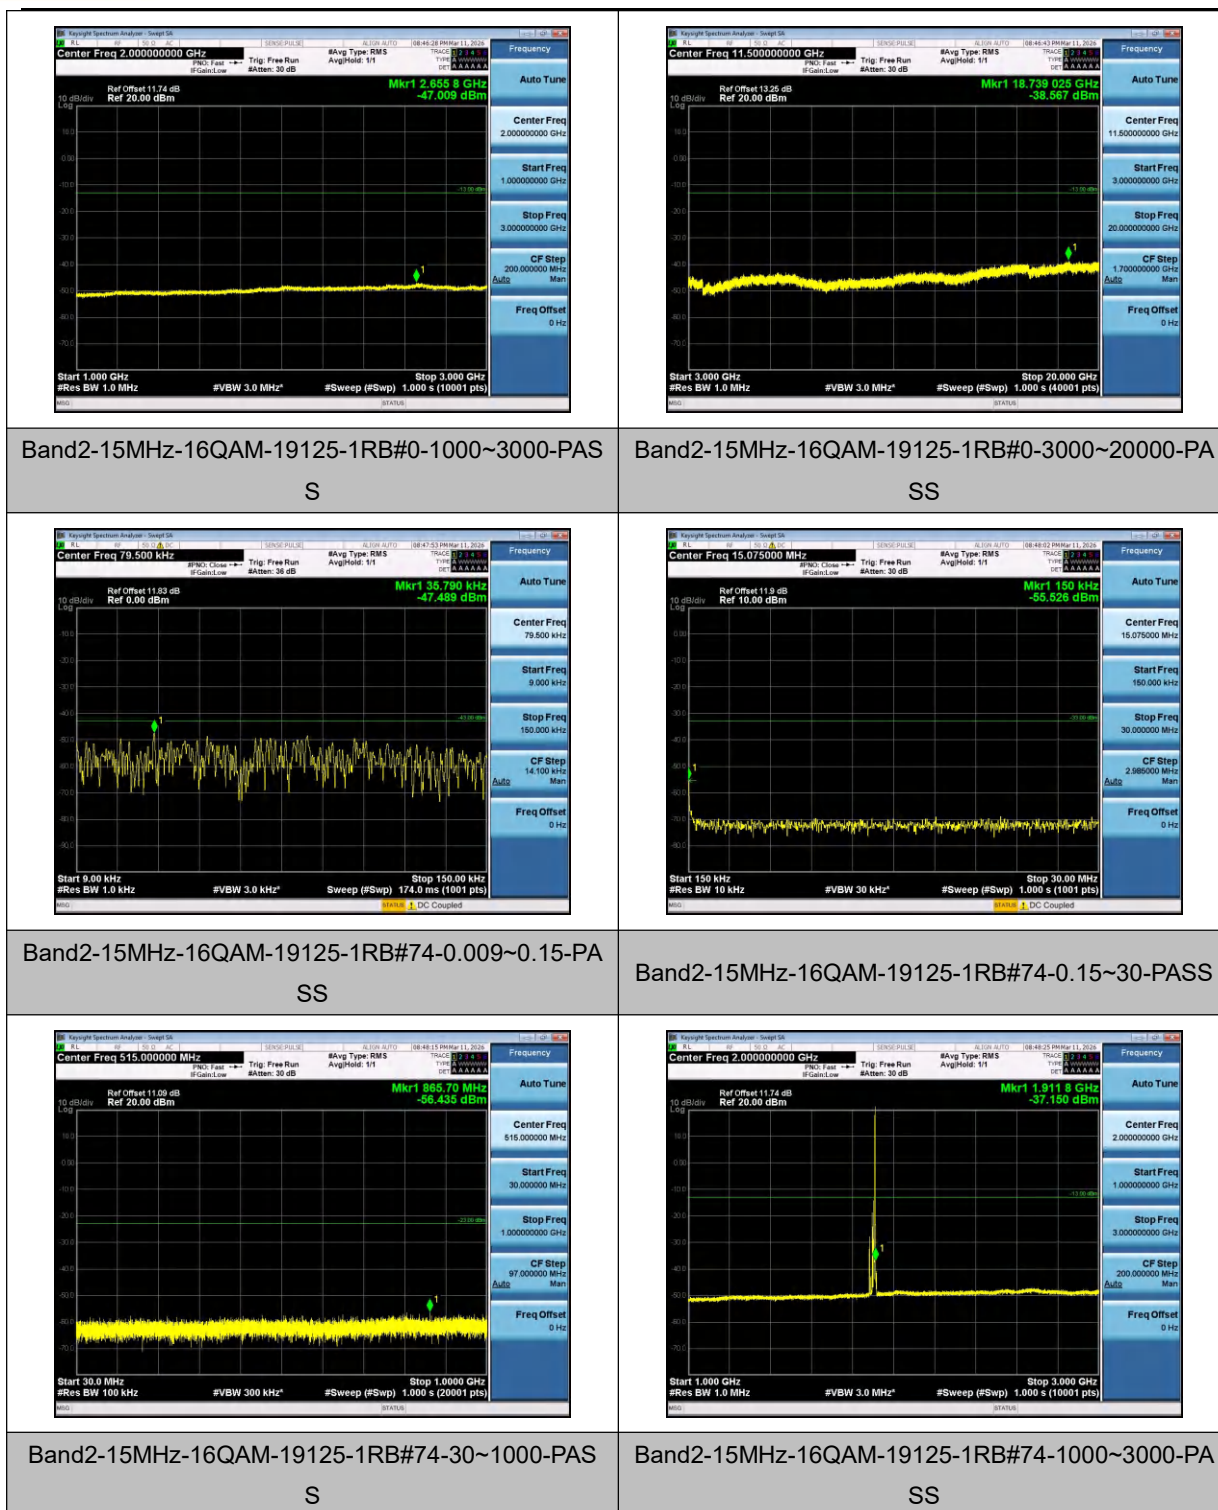
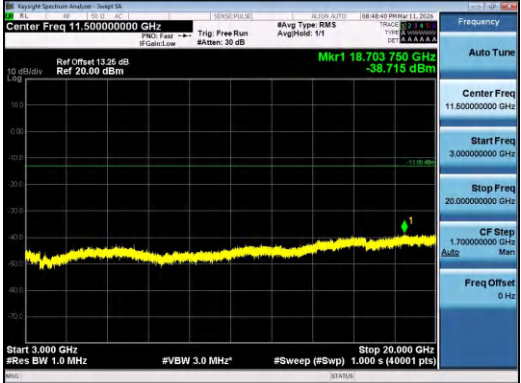
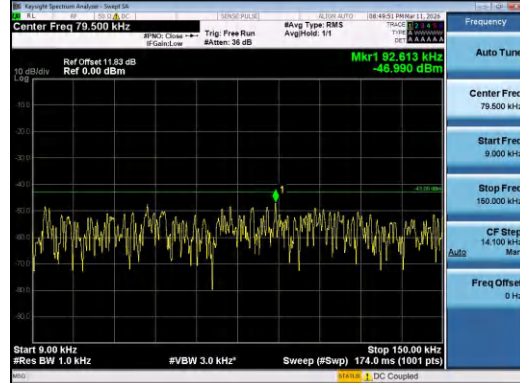
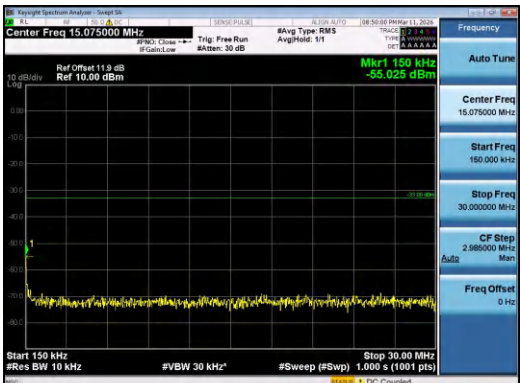
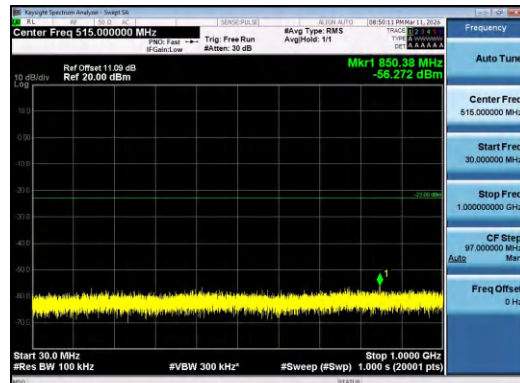


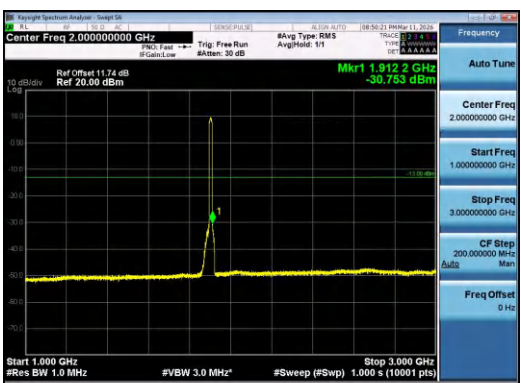


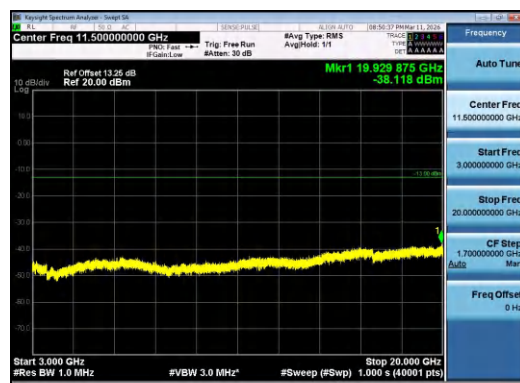



 Center Freq 11.50000000 GHz Ref Offset 13.26 dB Ref 20.00 dBm Mkr1 18.703 760 GHz -38.715 dBm Start 3.000 GHz #Res BW 1.0 MHz #VBW 3.0 MHz #Sweep (#Swp) 1.000 s (40001 pts)	 Center Freq 79.500 kHz Ref Offset 11.83 dB Ref 0.00 dBm Mkr1 82.613 kHz -46.990 dBm Start 9.00 kHz #Res BW 1.0 kHz #VBW 3.0 kHz Sweep (#Swp) 174.0 ms (1001 pts)
Band2-15MHz-16QAM-19125-1RB#74-3000~20000-P ASS	Band2-15MHz-16QAM-19125-75RB#0-0.009~0.15-PA SS
 Center Freq 15.075000 MHz Ref Offset 11.9 dB Ref 10.00 dBm Mkr1 150 kHz -55.025 dBm Start 150 kHz #Res BW 10 kHz #VBW 30 kHz #Sweep (#Swp) 1.000 s (10001 pts)	 Center Freq 515.000000 MHz Ref Offset 11.09 dB Ref 20.00 dBm Mkr1 850.33 MHz -56.272 dBm Start 30.0 MHz #Res BW 100 kHz #VBW 300 kHz #Sweep (#Swp) 1.000 s (20001 pts)
Band2-15MHz-16QAM-19125-75RB#0-0.15~30-PASS S	Band2-15MHz-16QAM-19125-75RB#0-30~1000-PAS S
 Center Freq 2.00000000 GHz Ref Offset 11.74 dB Ref 20.00 dBm Mkr1 1.912 2 GHz -30.753 dBm Start 1.000 GHz #Res BW 1.0 MHz #VBW 3.0 MHz #Sweep (#Swp) 1.000 s (10001 pts)	 Center Freq 11.50000000 GHz Ref Offset 13.26 dB Ref 20.00 dBm Mkr1 19.929 875 GHz -38.118 dBm Start 3.000 GHz #Res BW 1.0 MHz #VBW 3.0 MHz #Sweep (#Swp) 1.000 s (40001 pts)
Band2-15MHz-16QAM-19125-75RB#0-1000~3000-PA SS	Band2-15MHz-16QAM-19125-75RB#0-3000~20000-P ASS

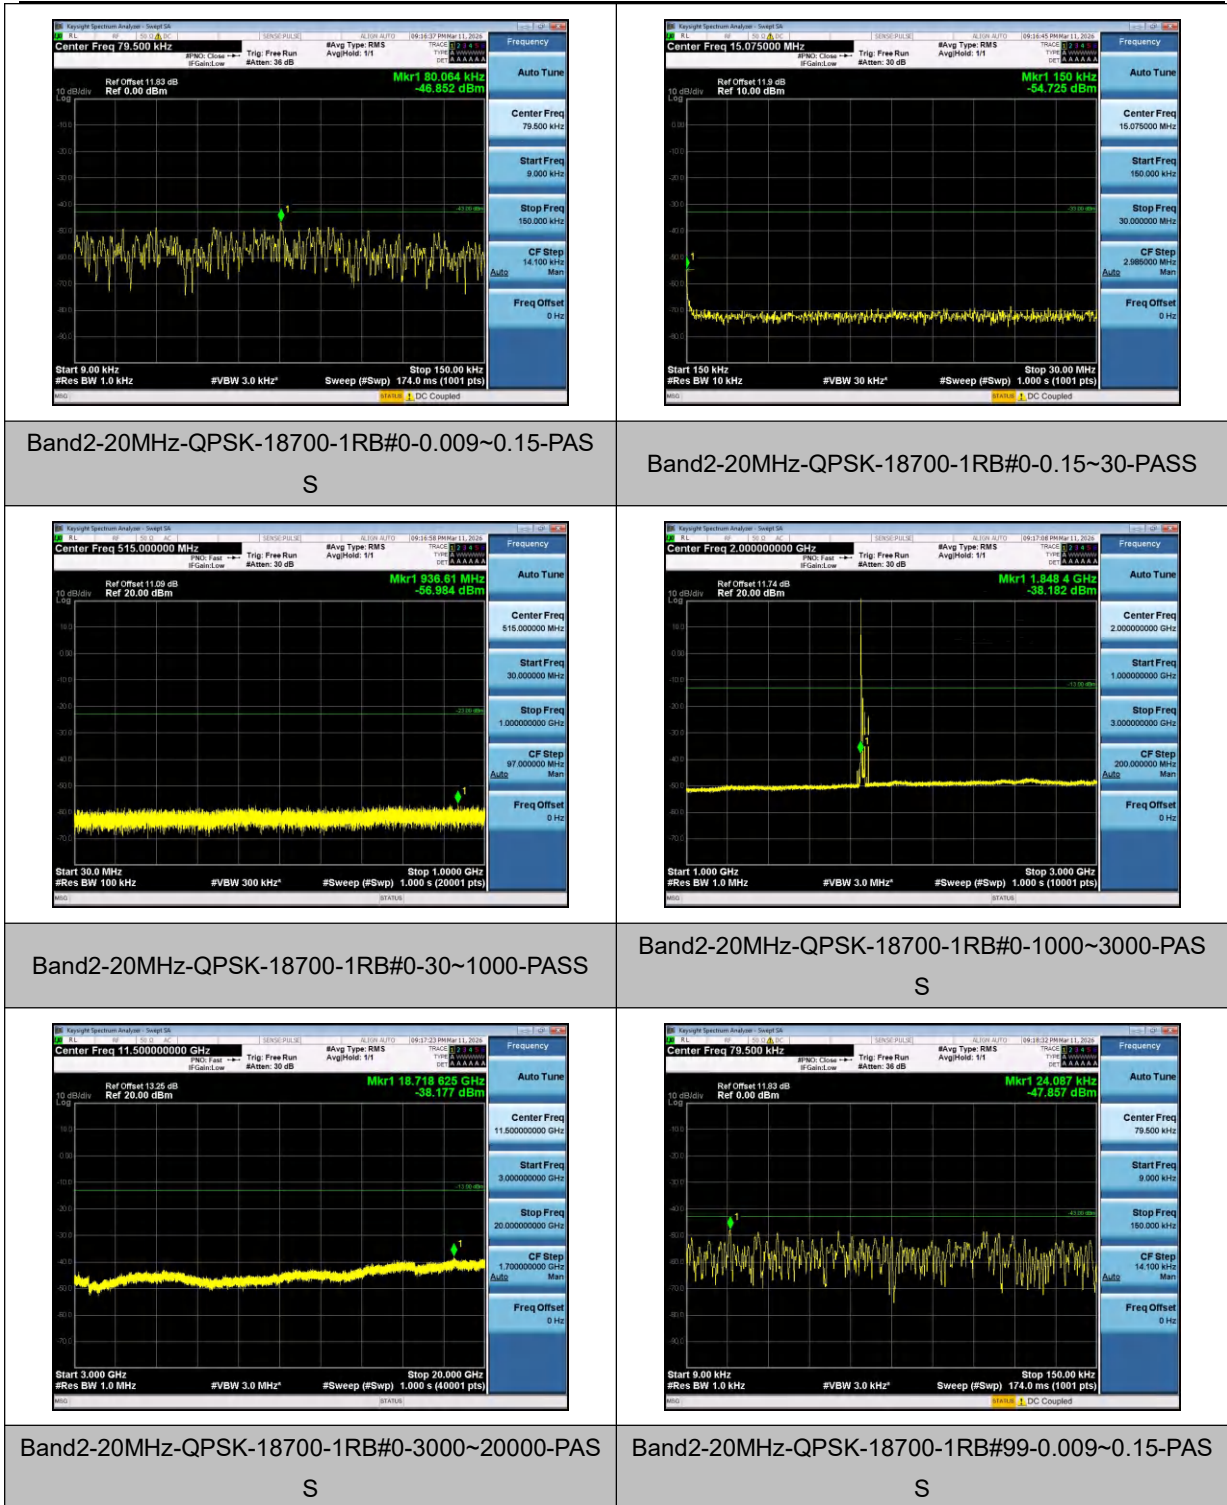


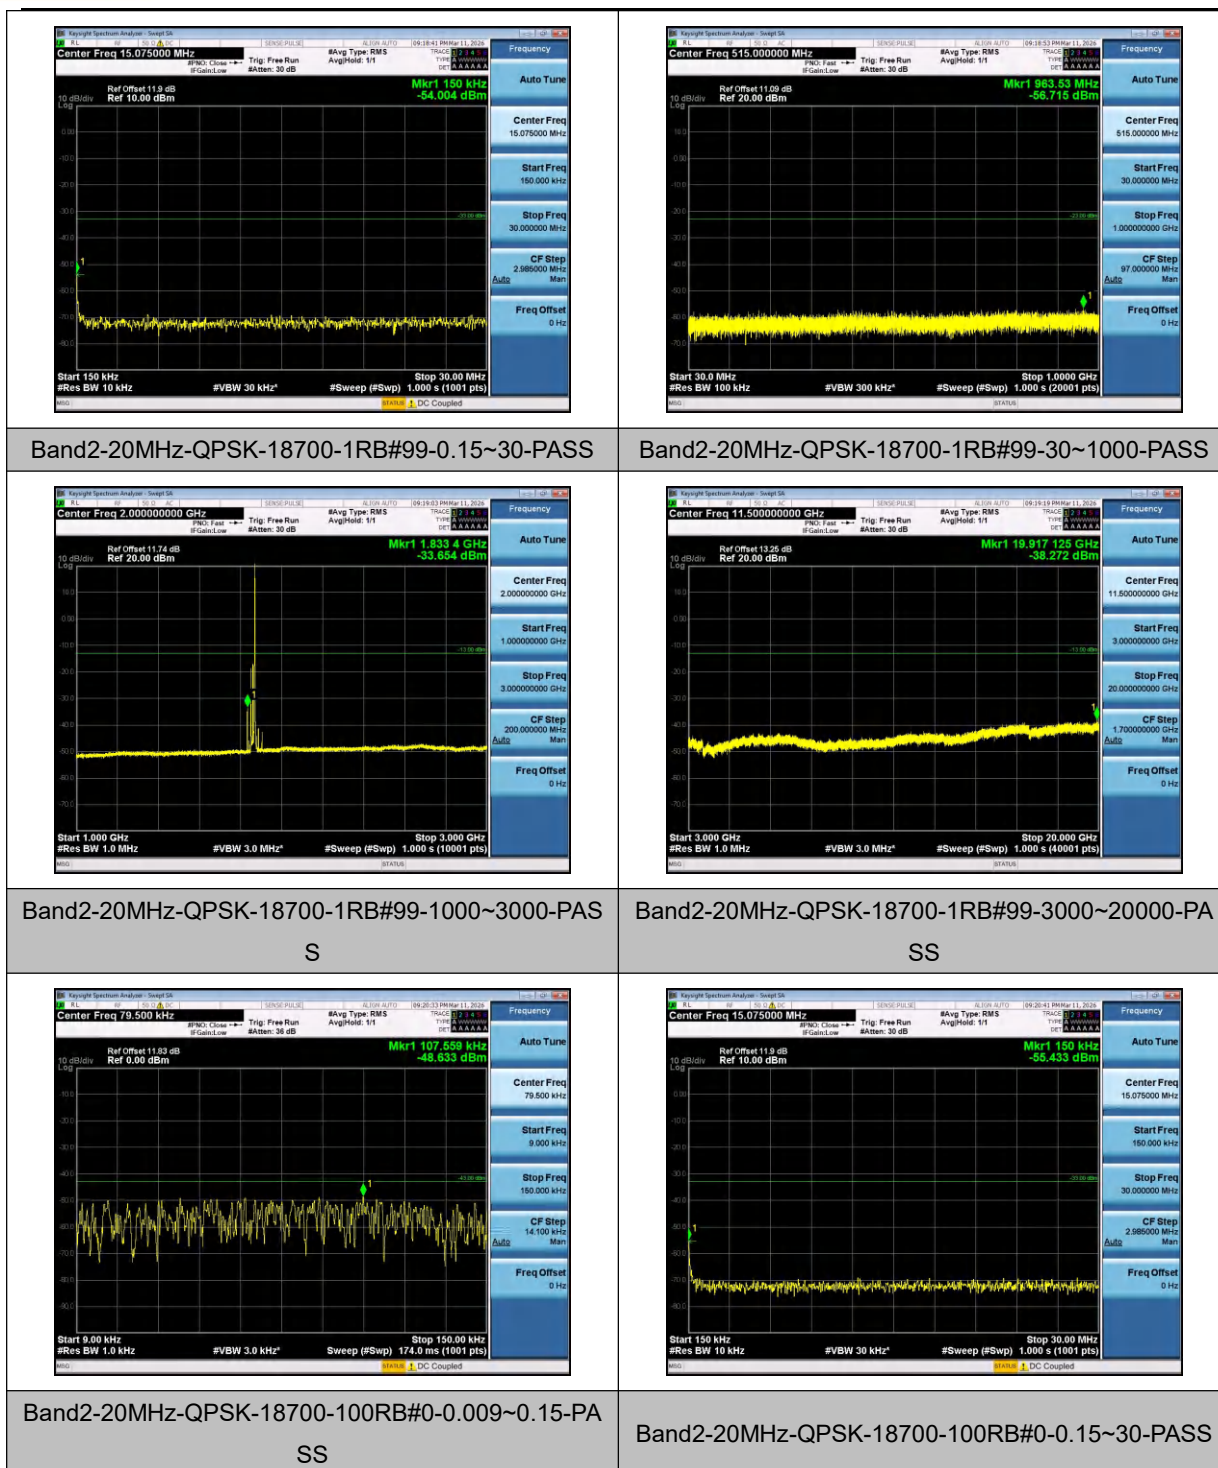


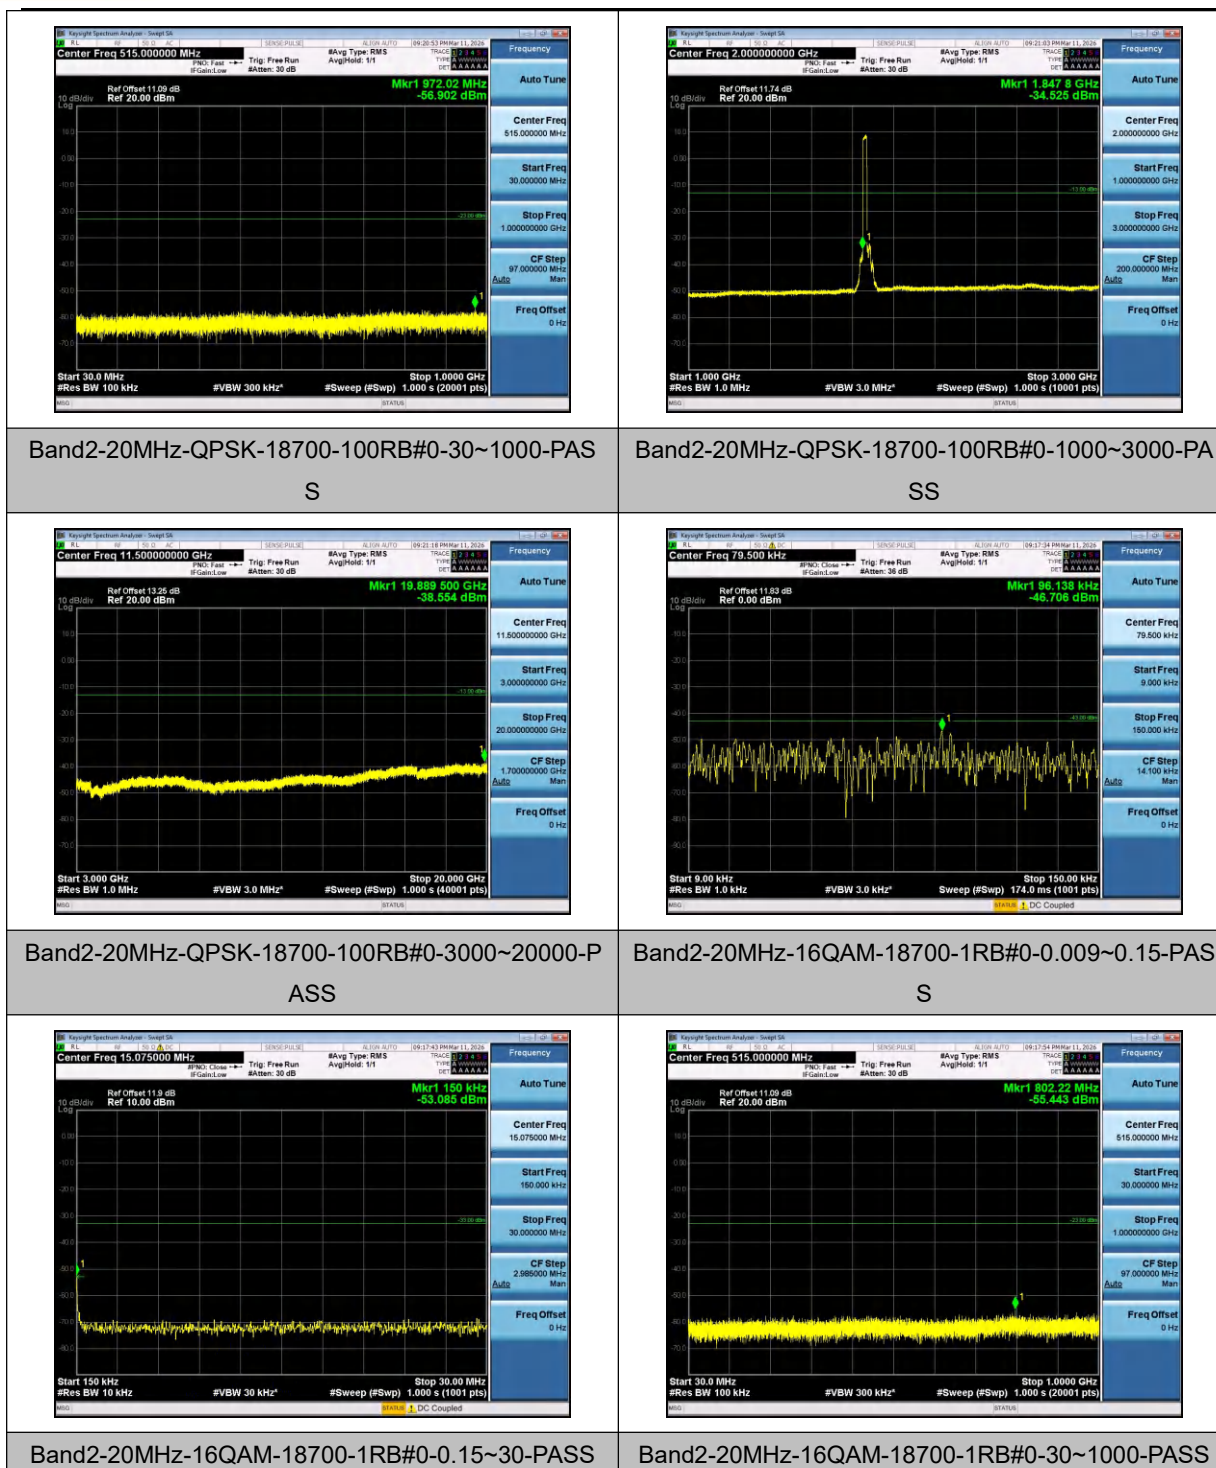


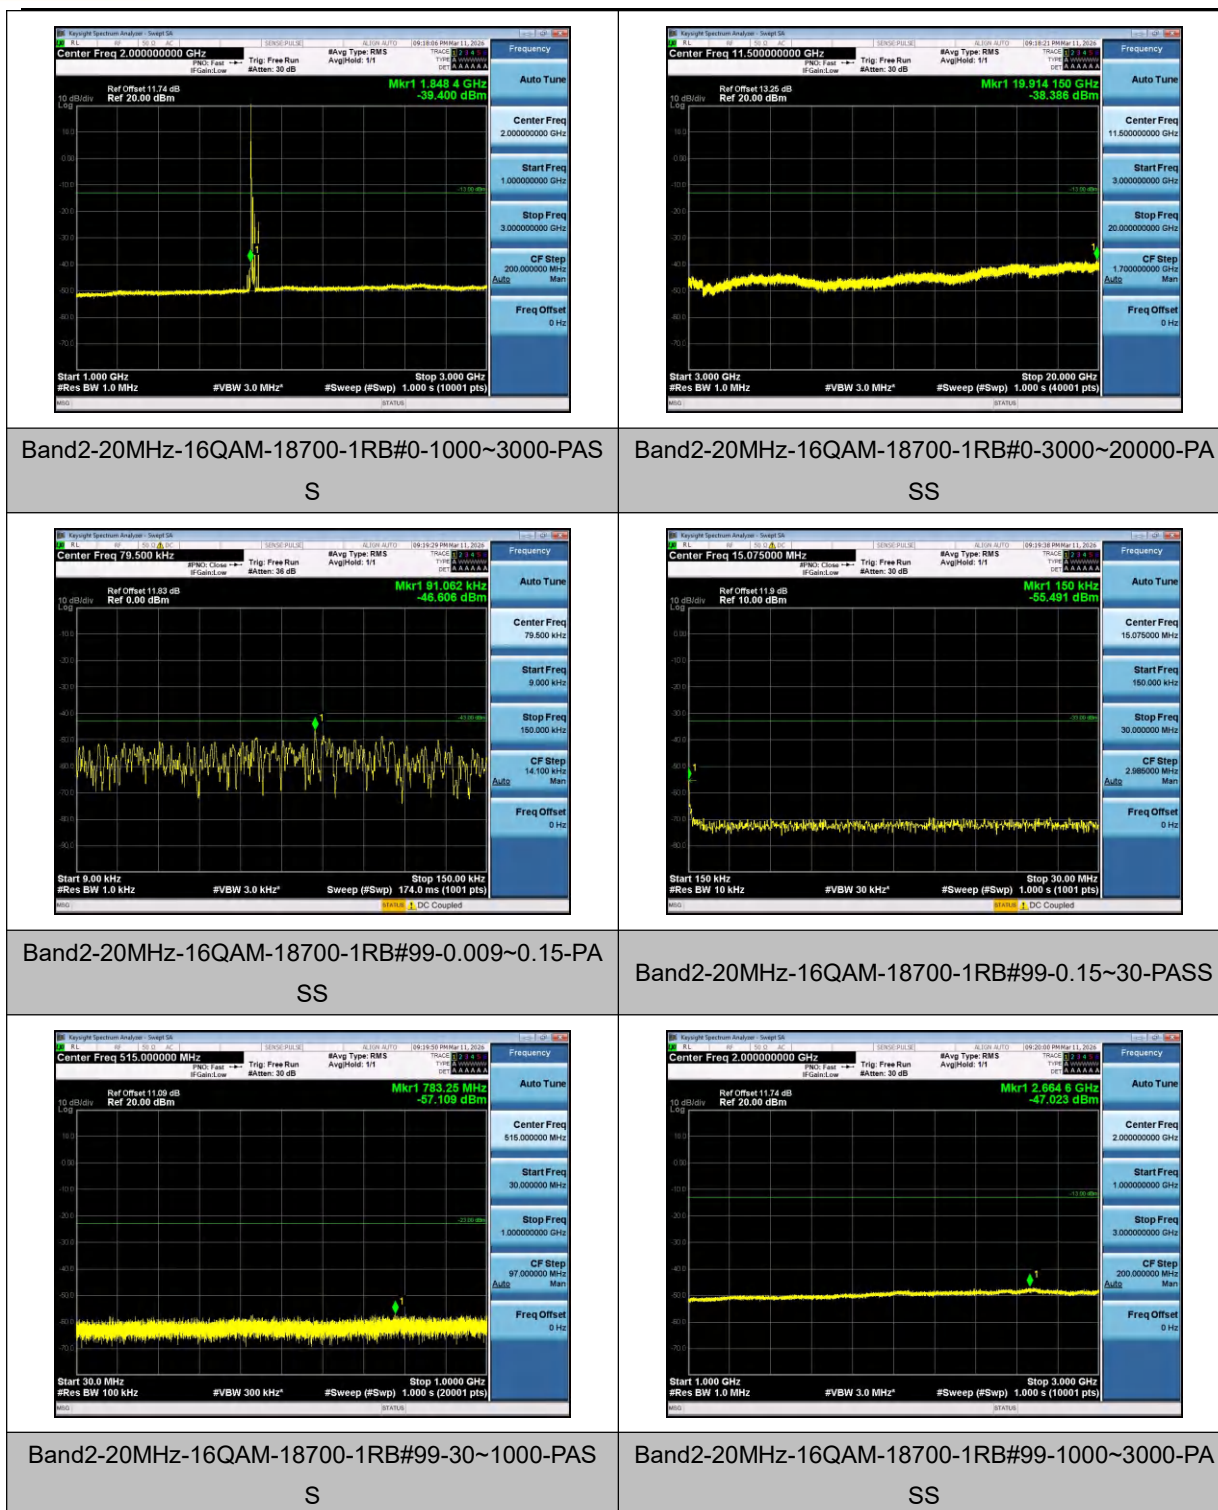


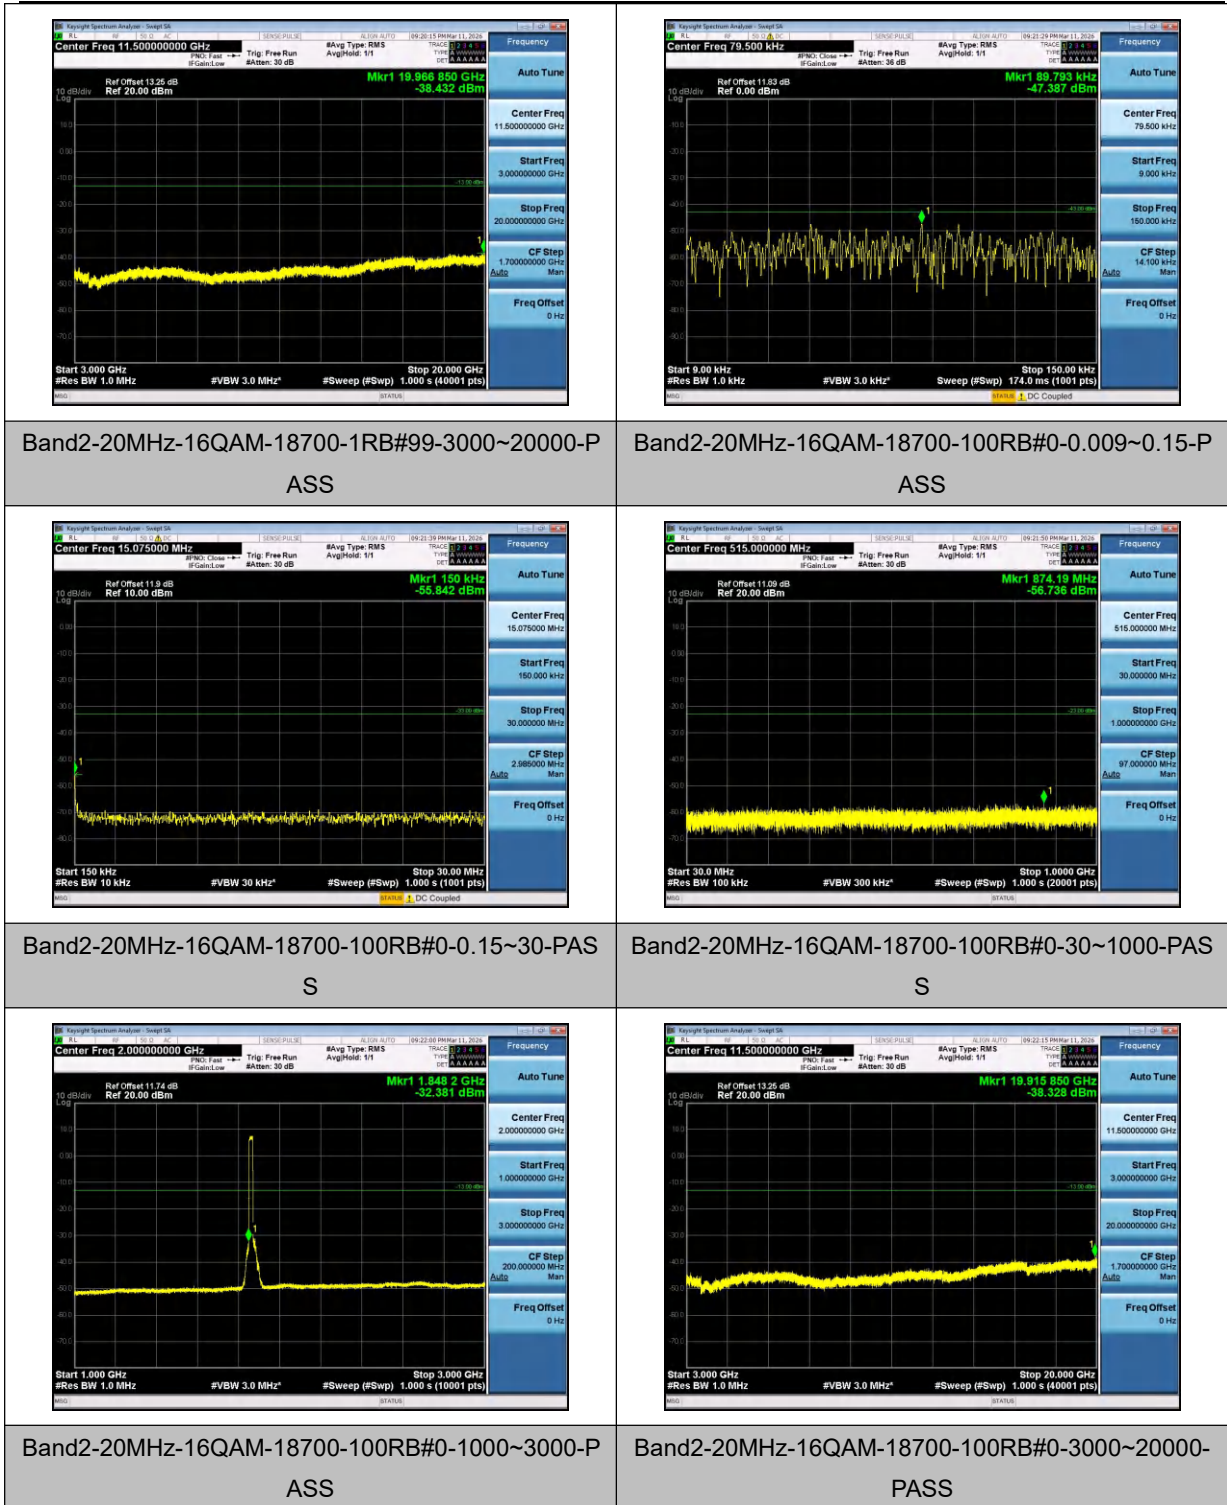


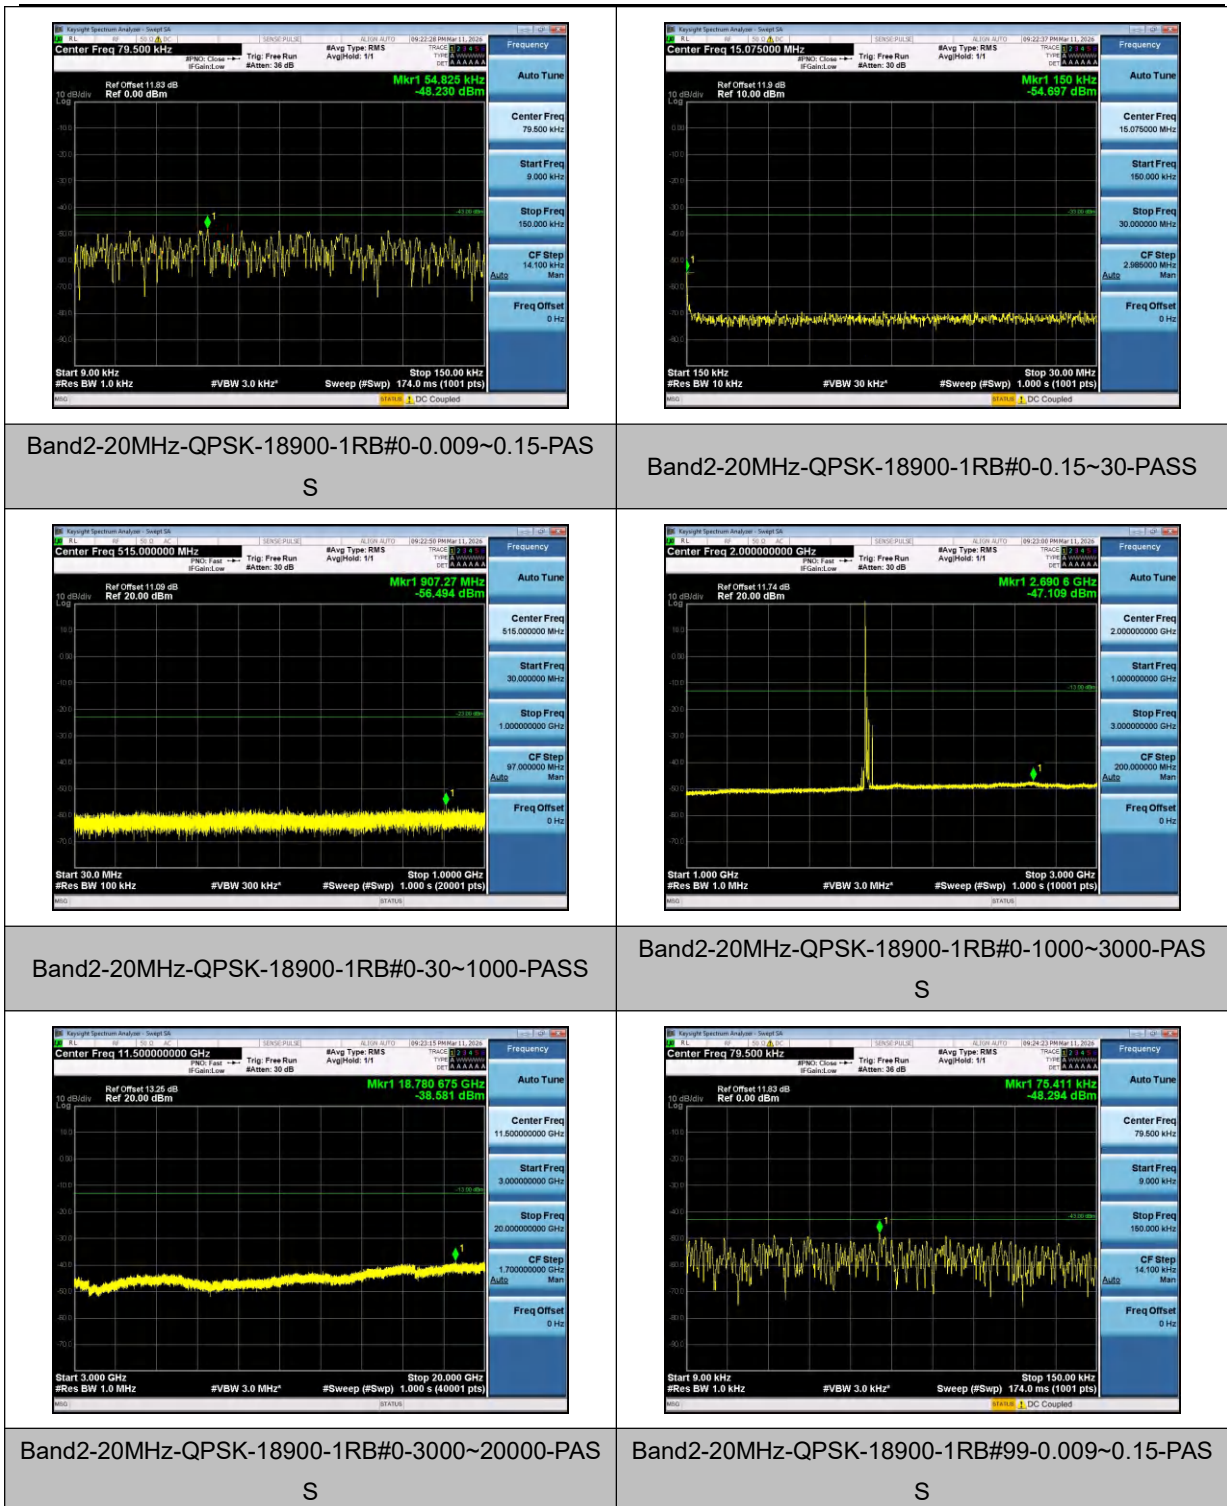


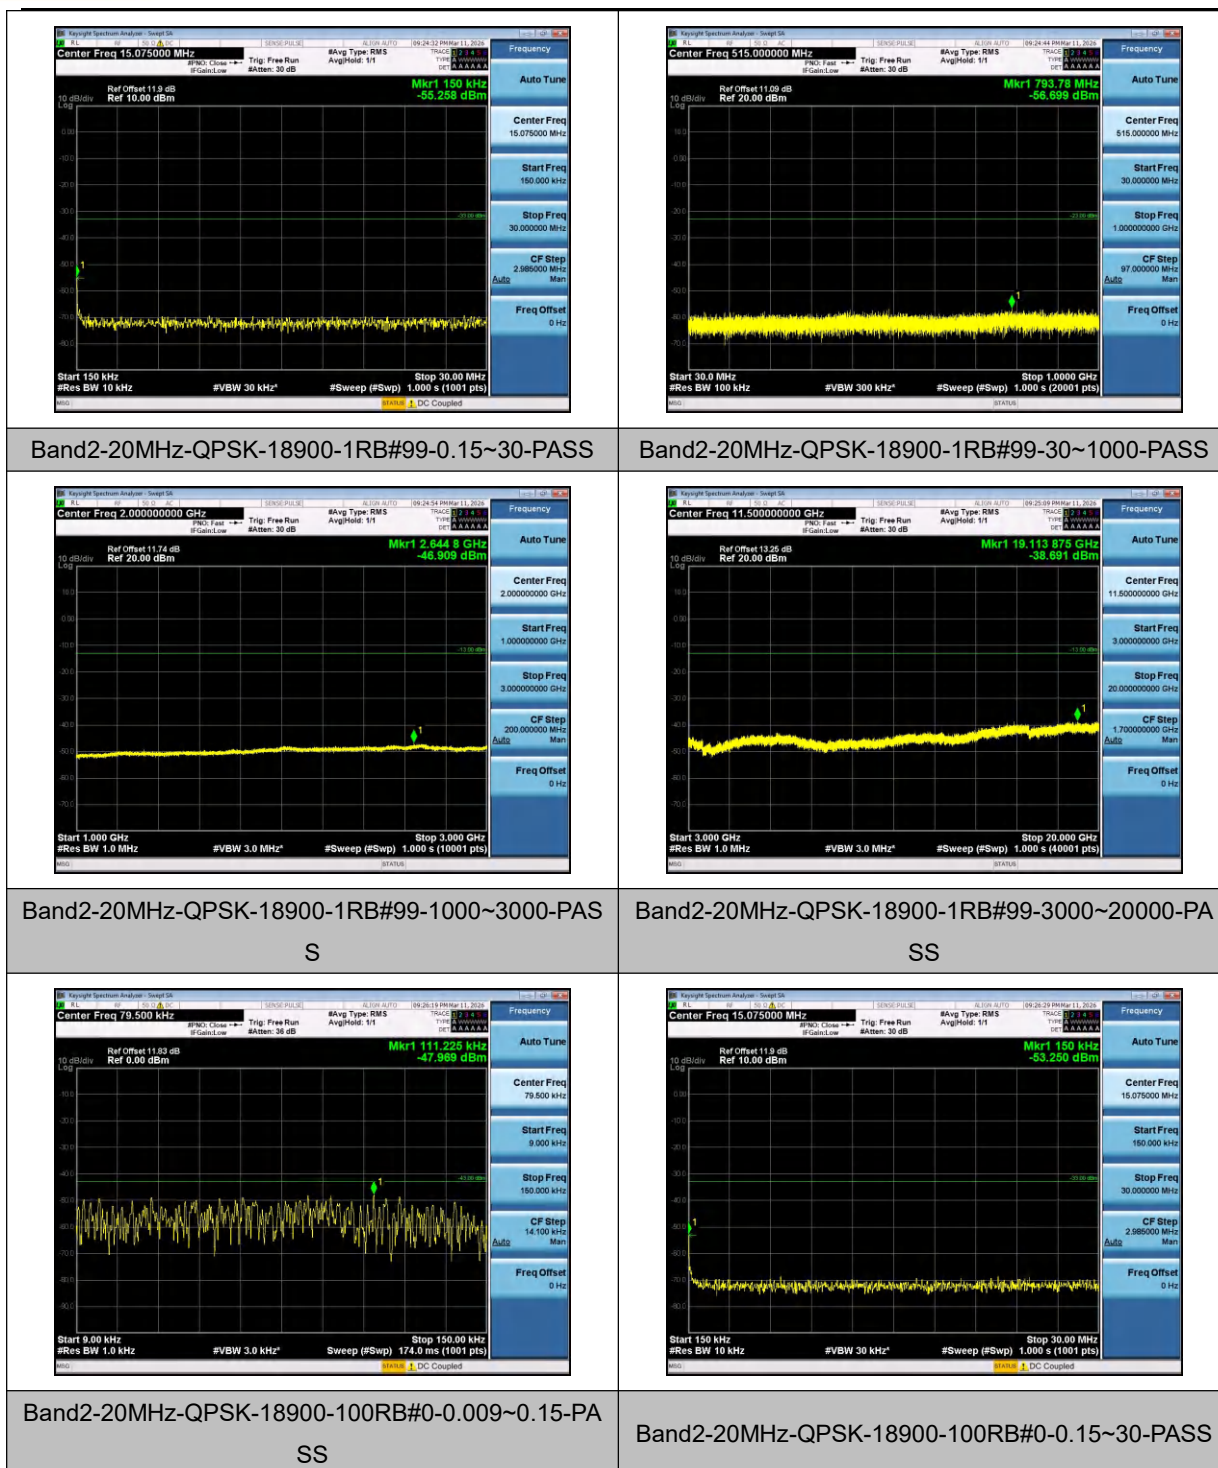


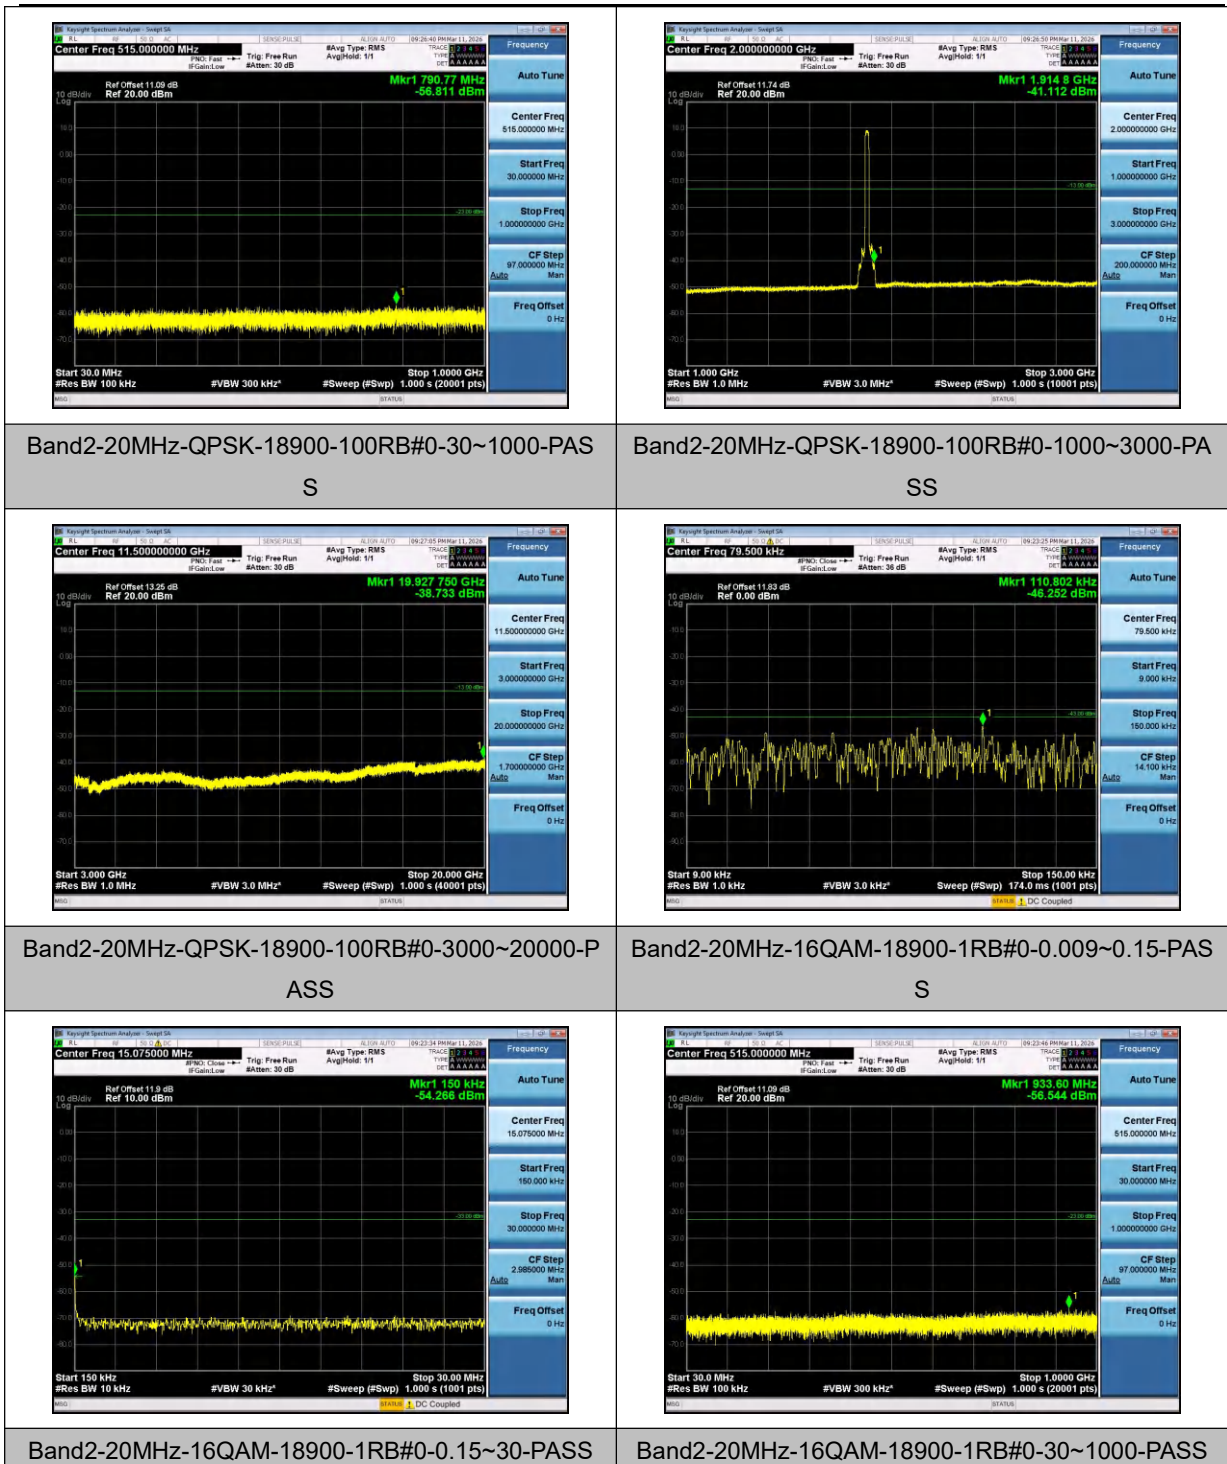


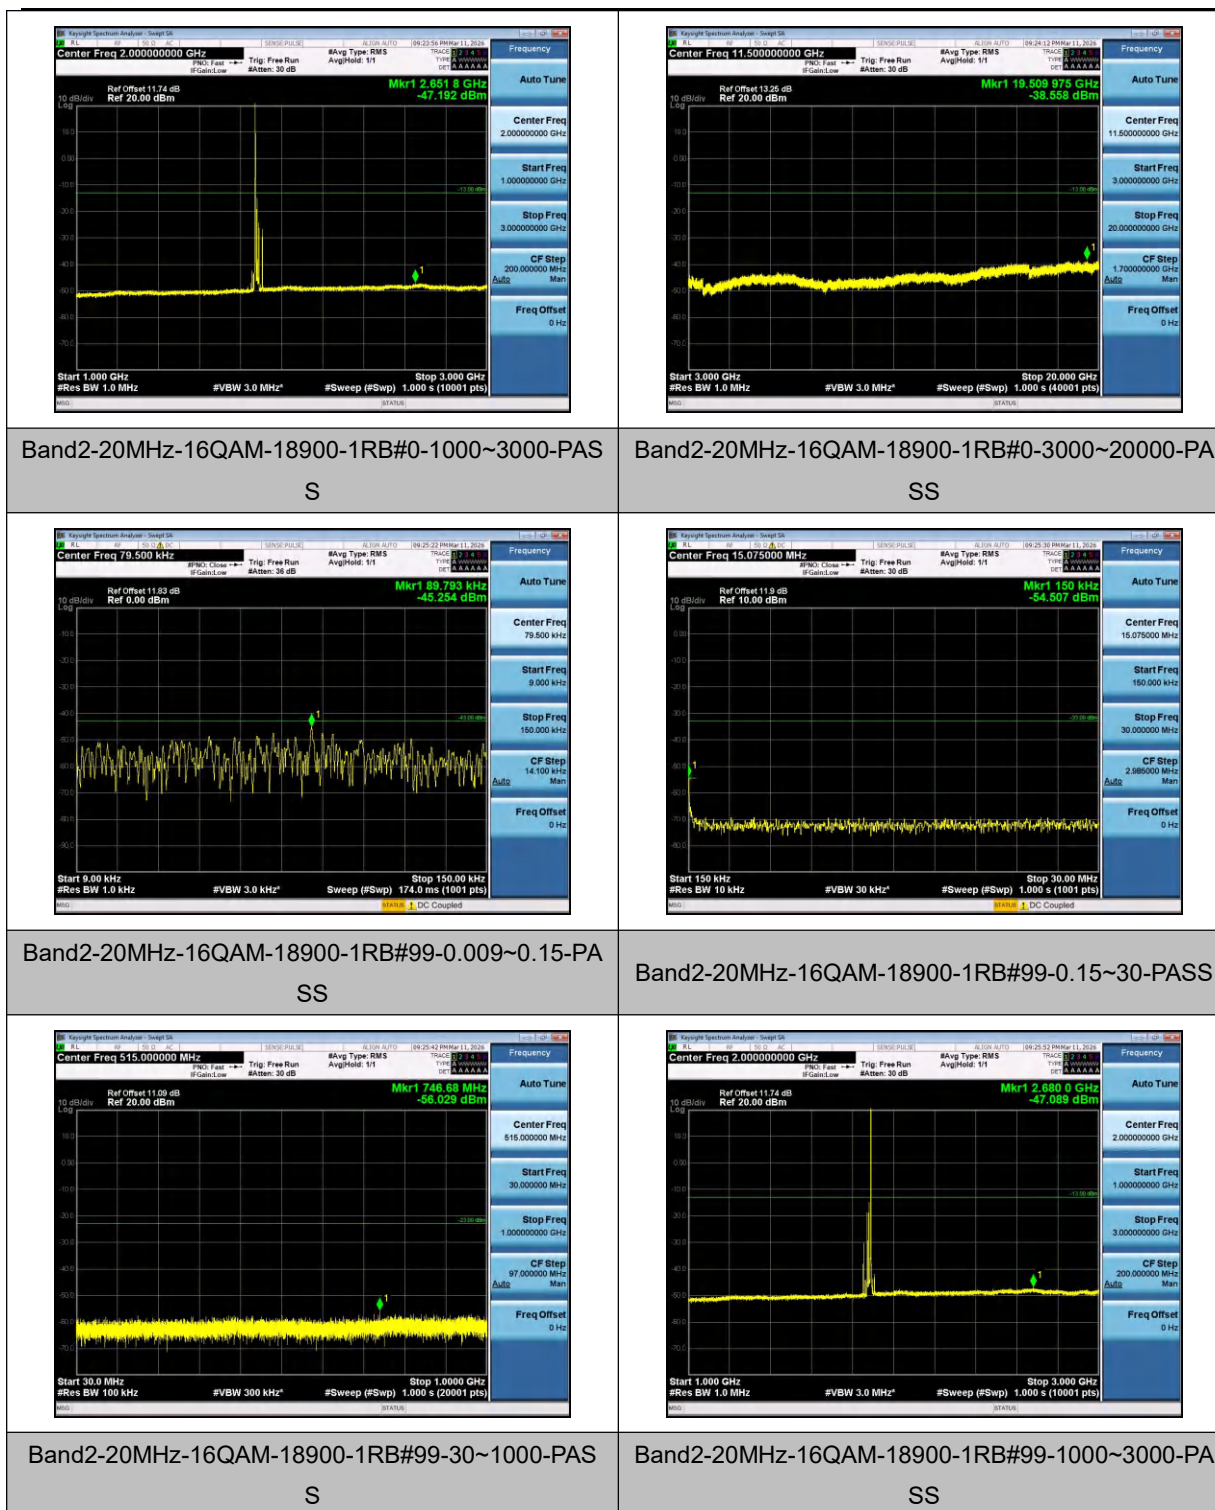


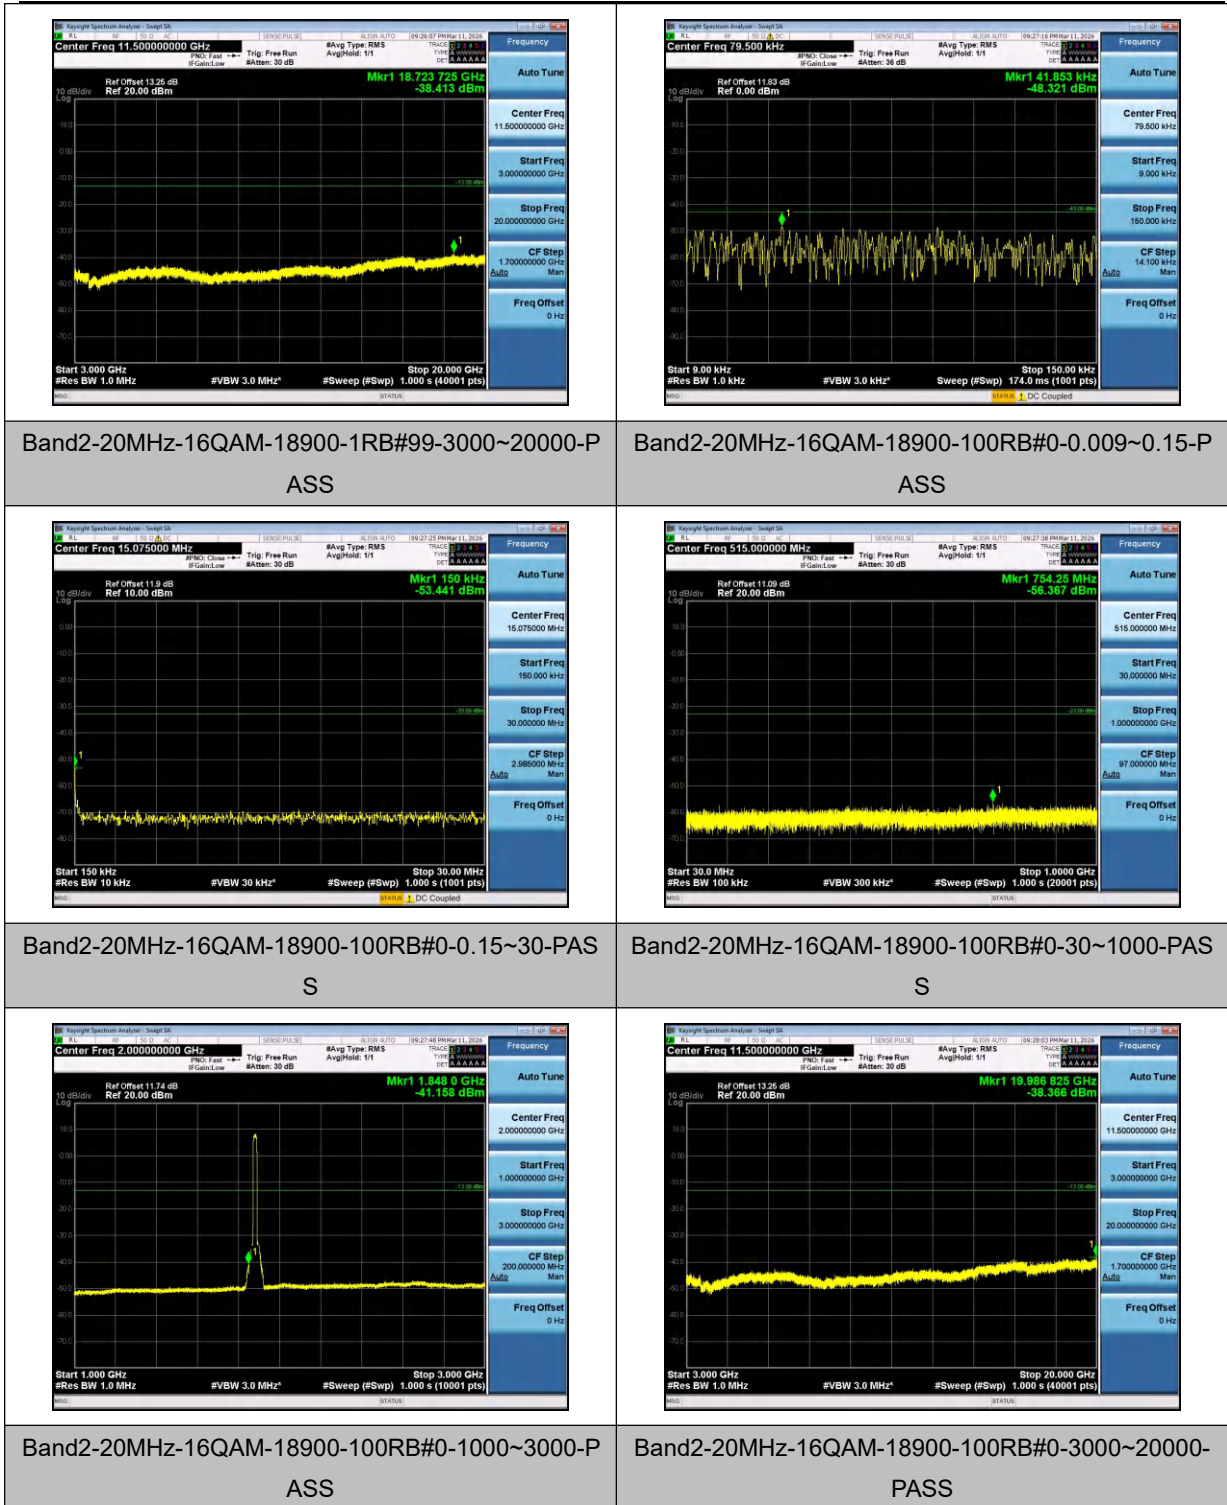


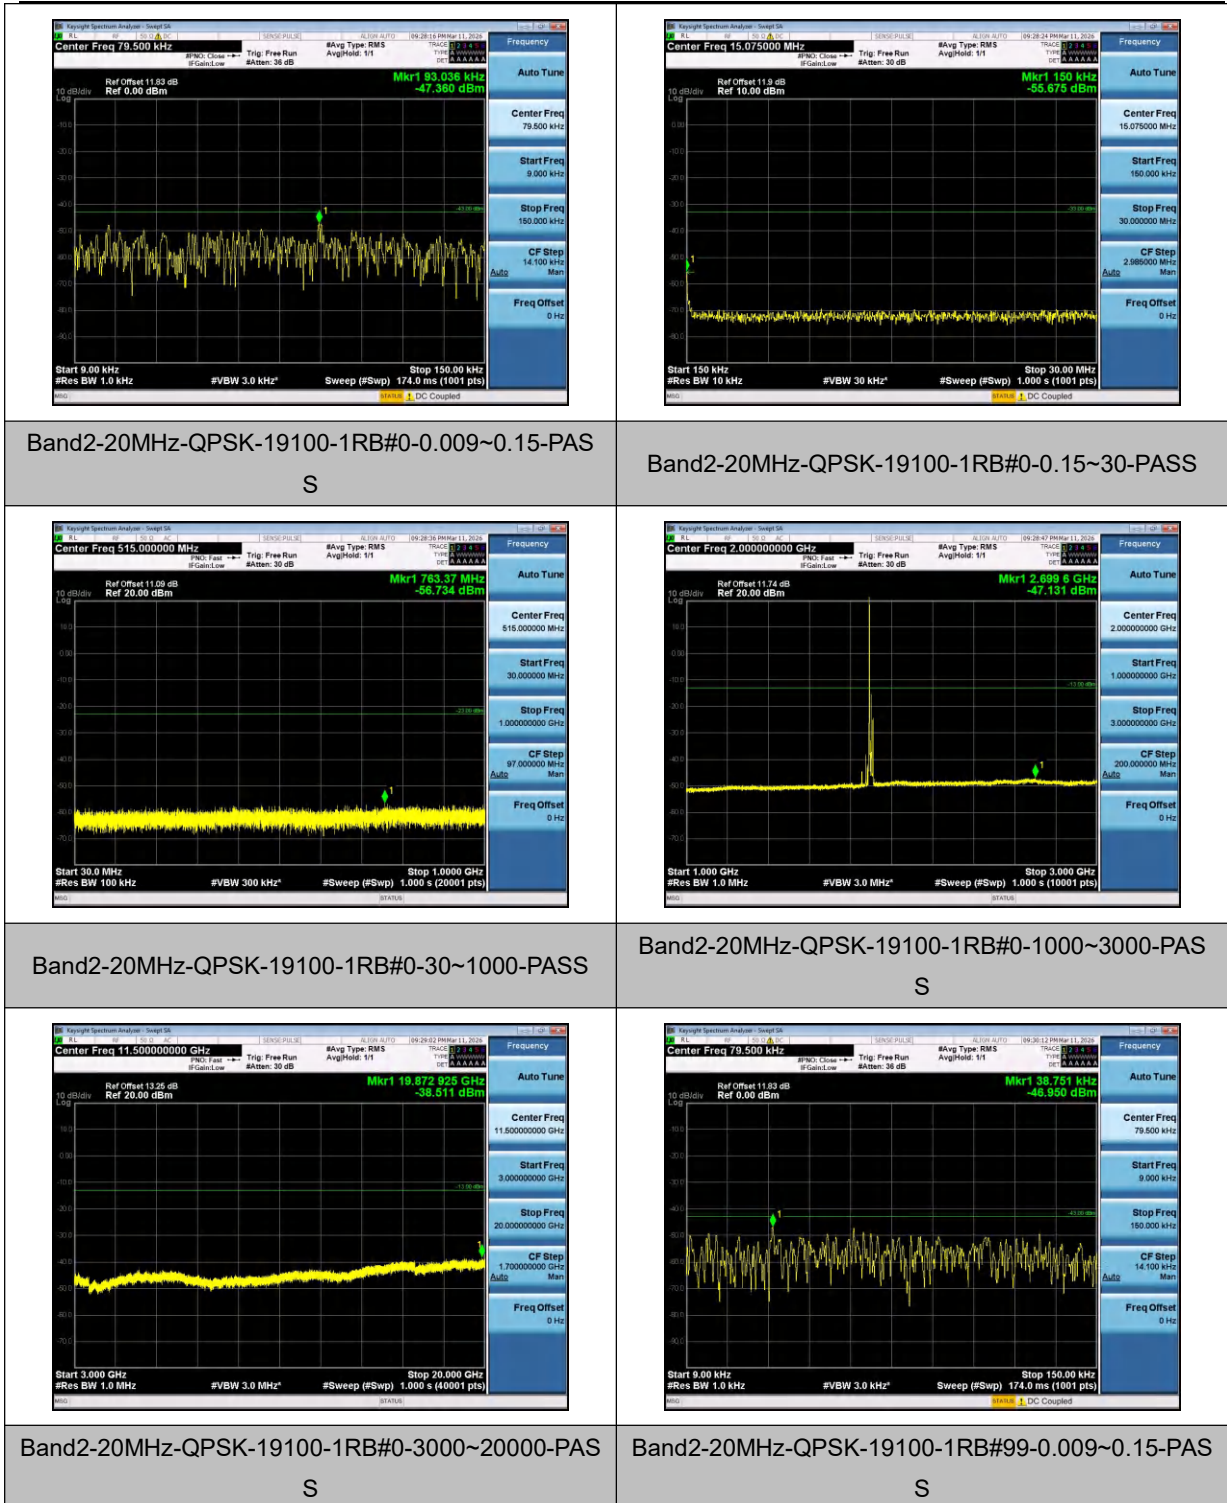

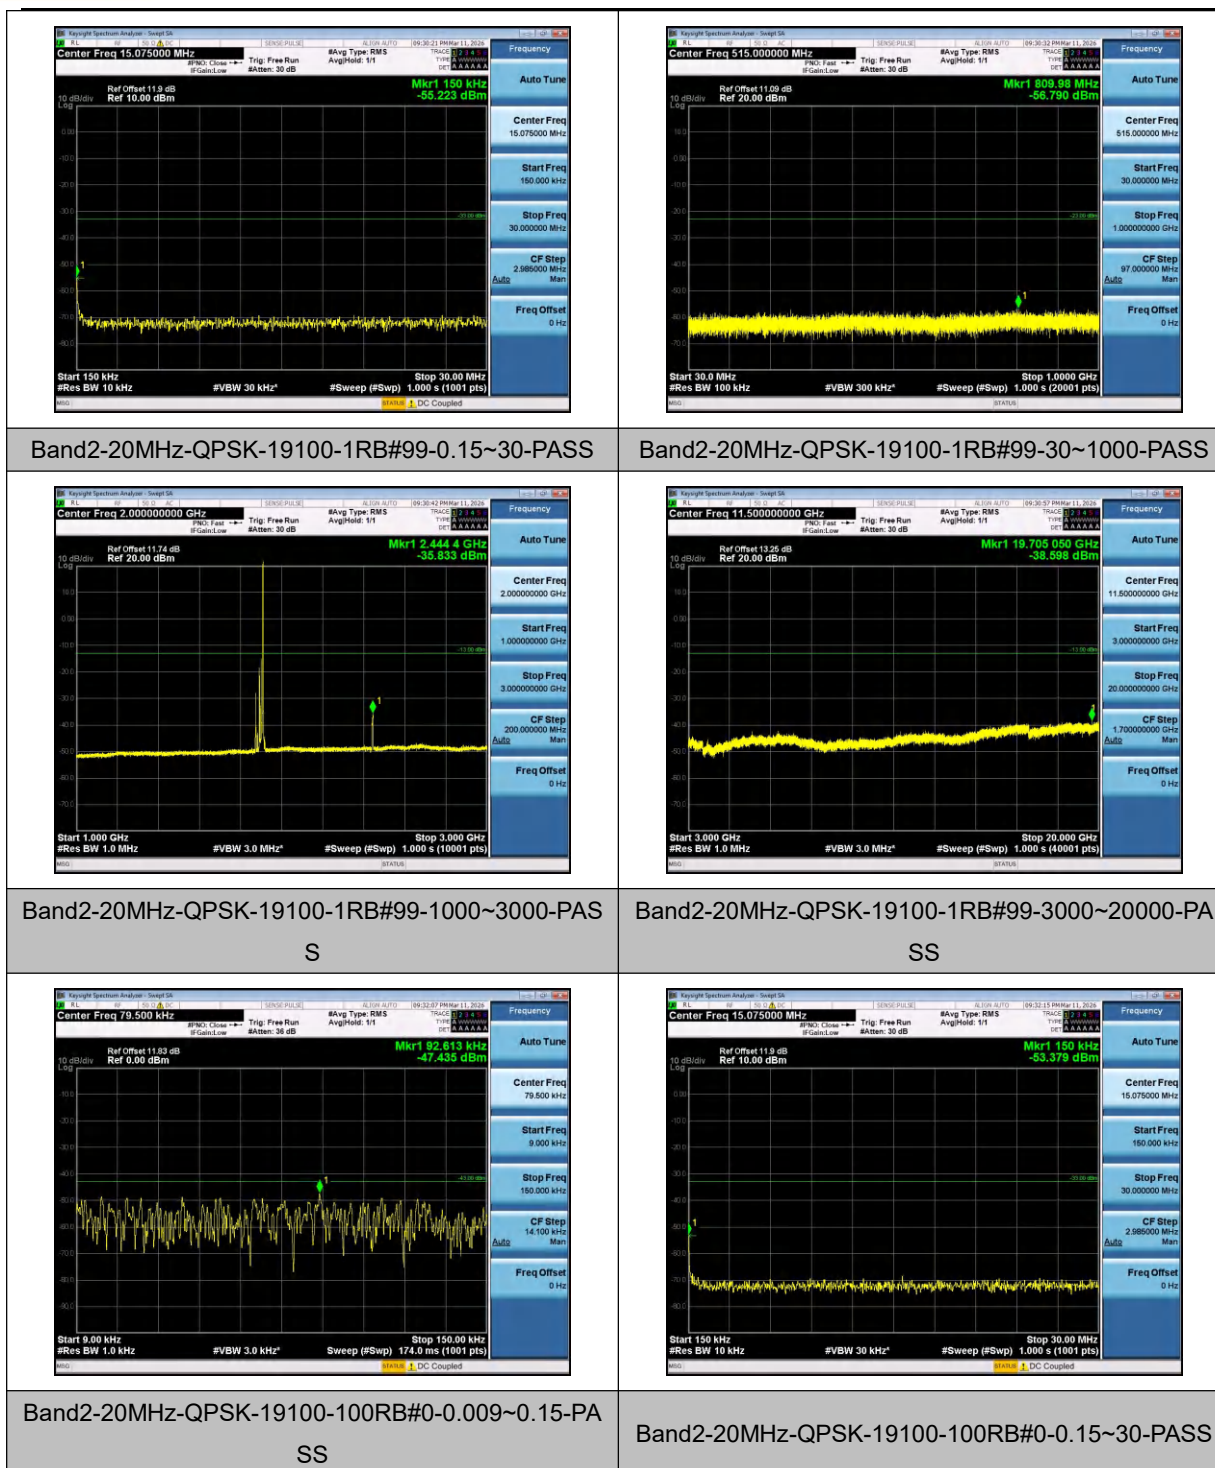

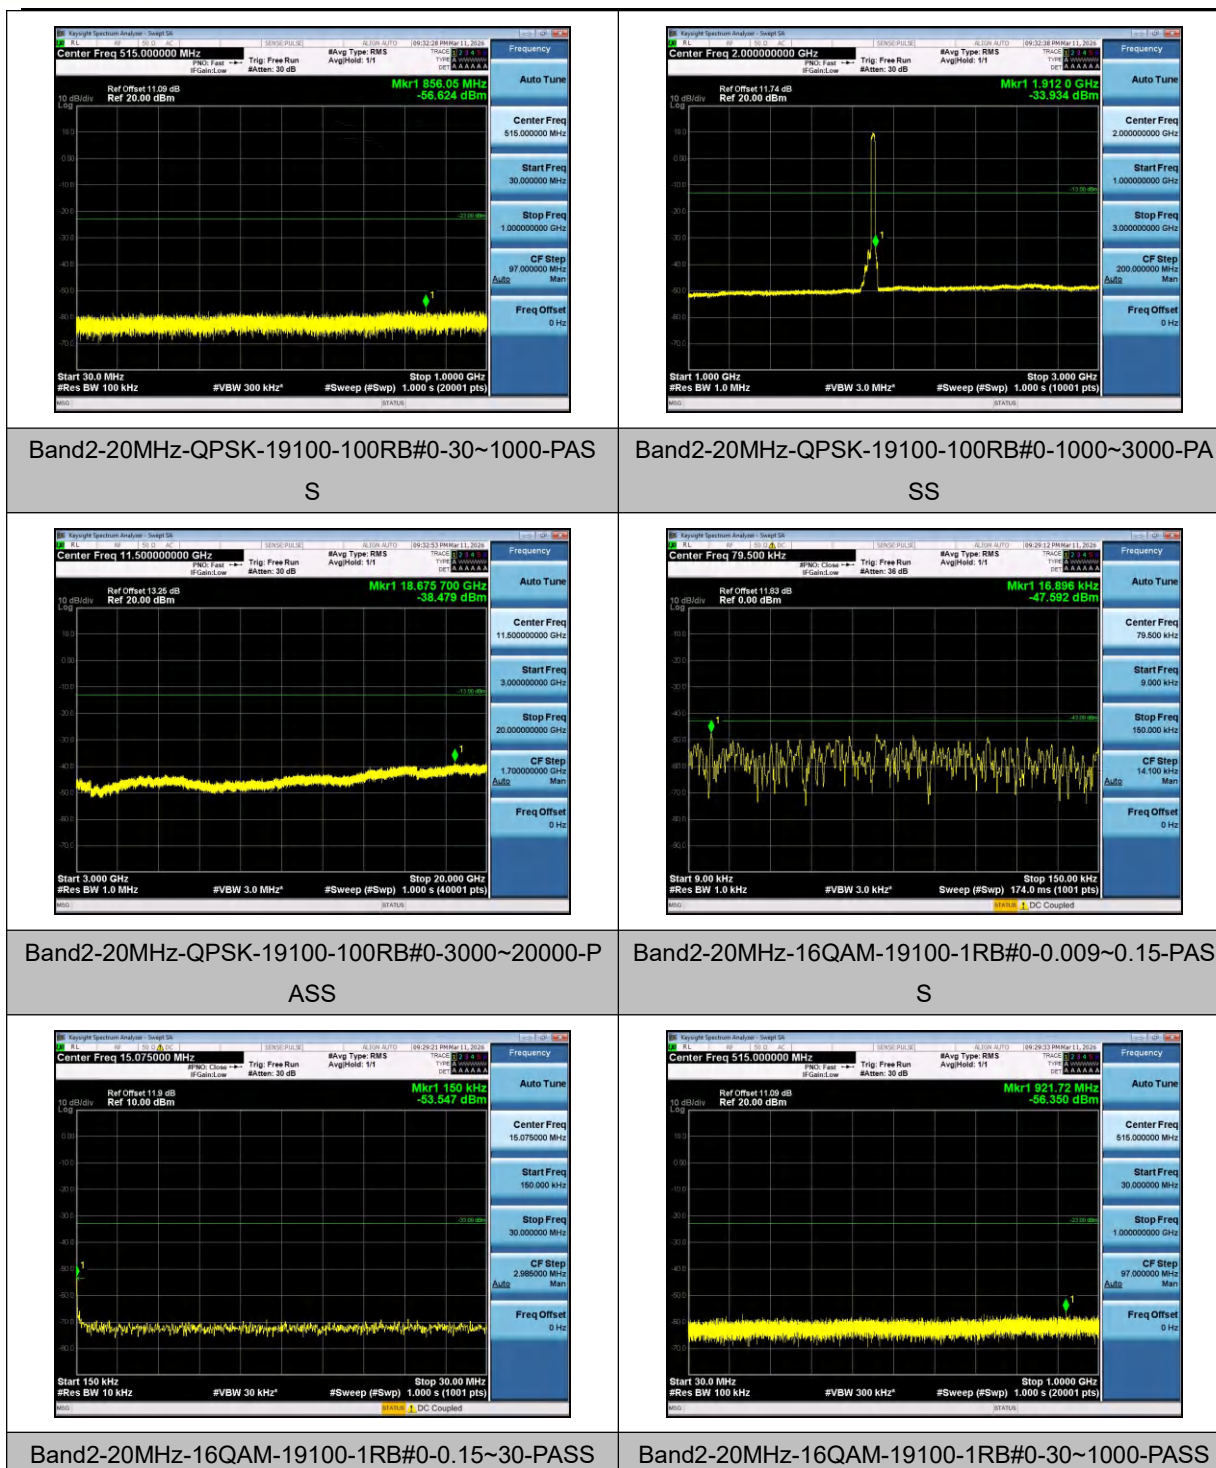

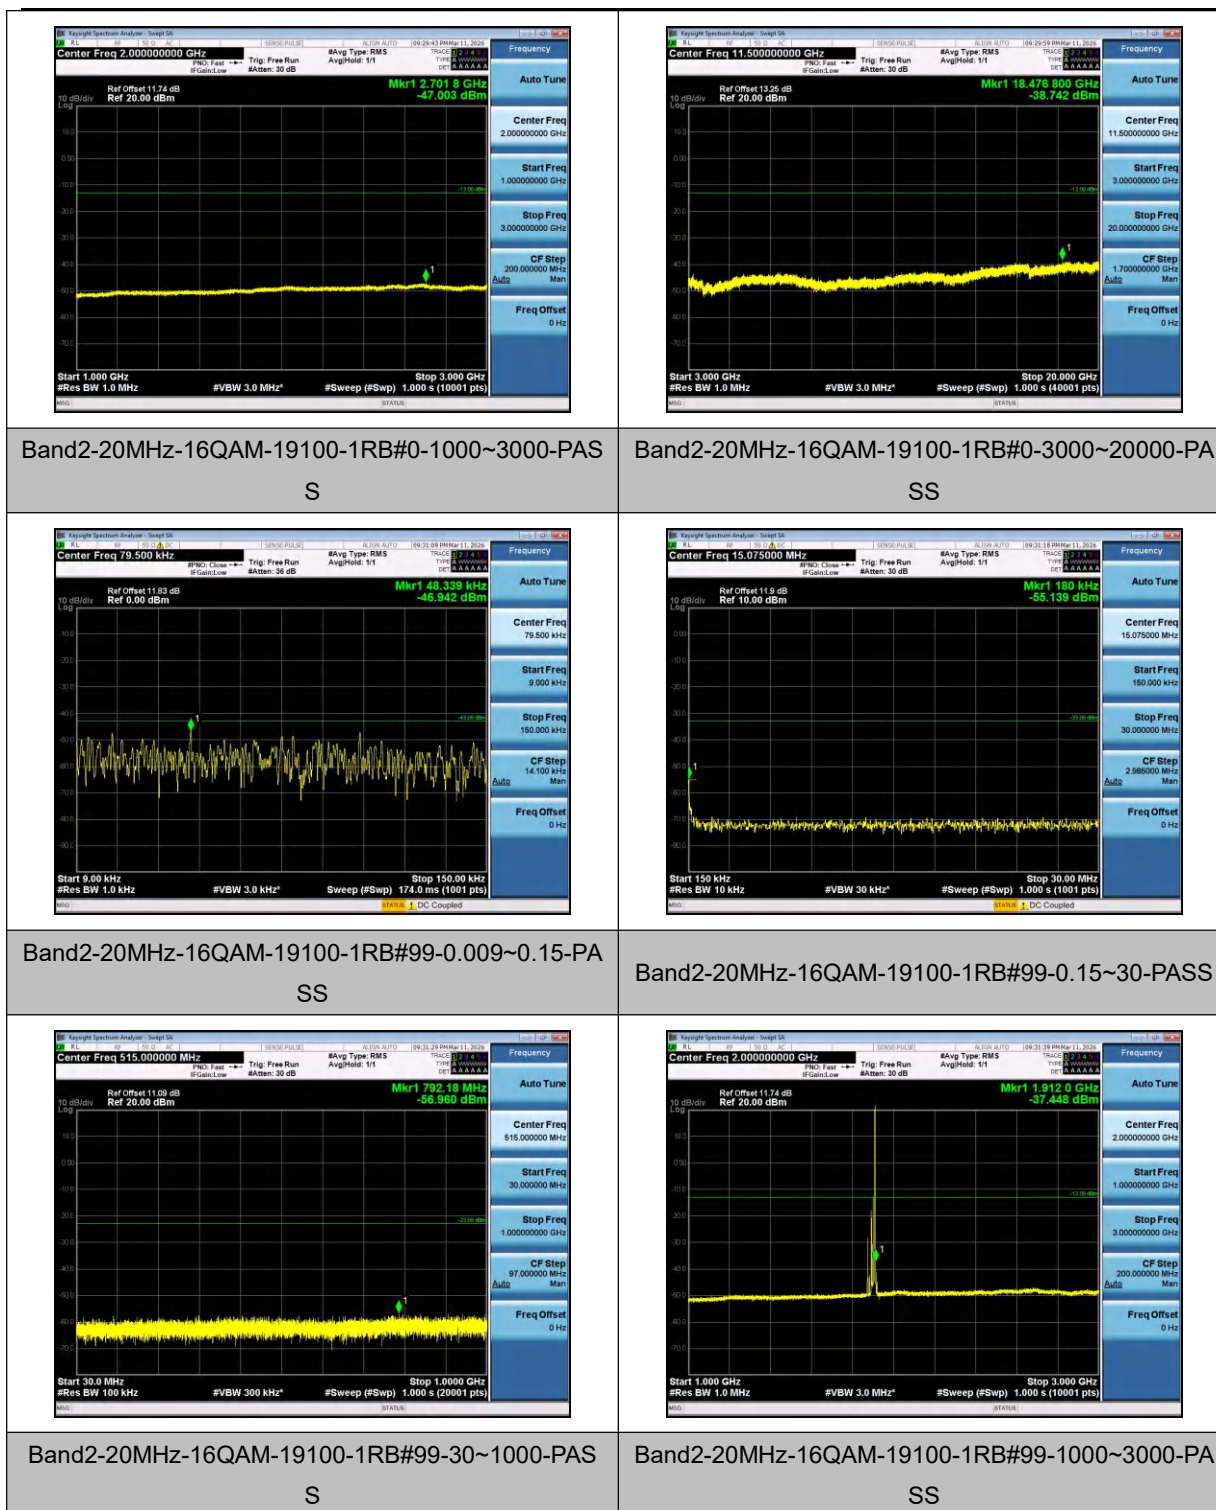

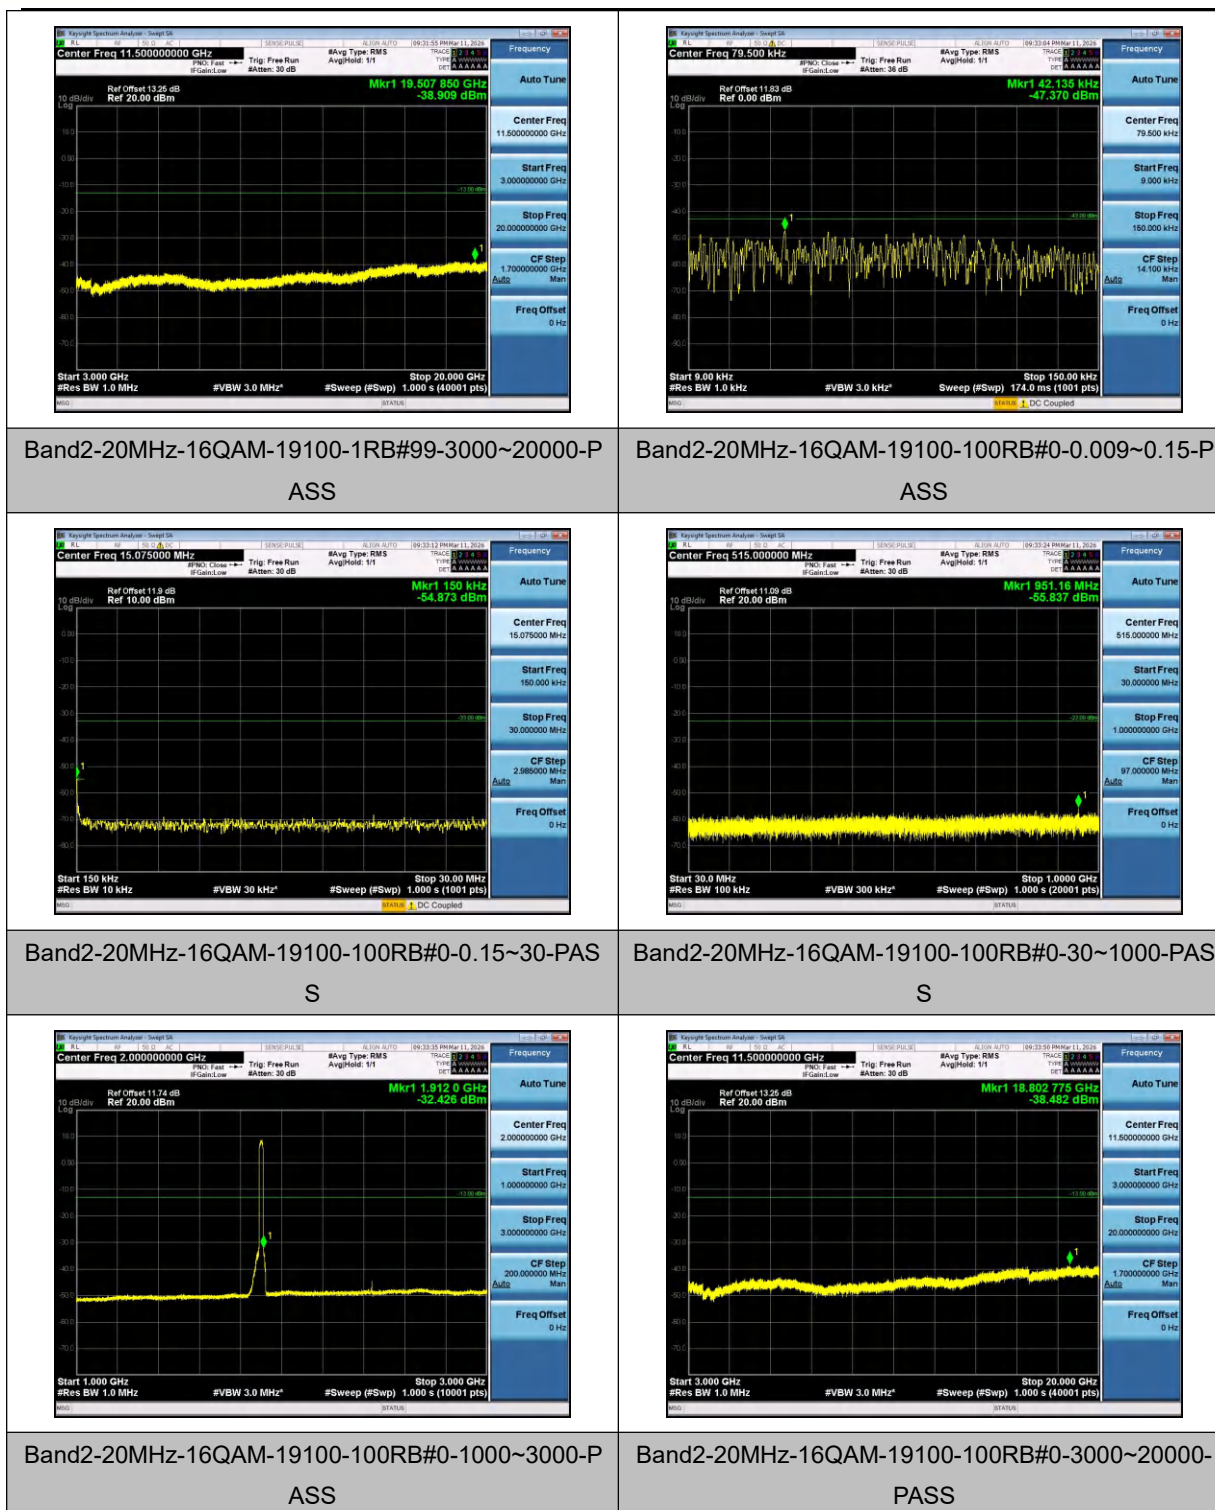

Appendix F: Frequency Stability

Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	1850.15665	1851.23805	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	1850.1574	1851.2385	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	1850.15801	1851.23811	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	1850.156	1851.238	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	1850.15643	1851.23793	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	1850.15577	1851.23857	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	1879.45649	1880.53679	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	1879.45816	1880.53686	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	1879.45721	1880.53781	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	1879.45585	1880.53805	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	1879.45763	1880.53783	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	1879.45756	1880.53676	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	1908.75663	1909.83873	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	1908.75701	1909.83501	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	1908.75703	1909.83743	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	1908.75689	1909.83679	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	1908.75564	1909.83884	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	1908.75682	1909.83822	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	VN	NT	1850.16076	1852.84036	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	1850.15641	1852.84391	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	1850.15673	1852.84133	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	1850.15856	1852.83406	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	1850.15778	1852.83728	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	1850.15808	1852.83698	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	1878.65875	1881.34025	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	1878.66012	1881.34612	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	1878.6578	1881.3463	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	1878.65799	1881.33999	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	1878.6591	1881.3401	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	1878.65836	1881.33416	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	1907.1613	1909.8396	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	1907.15567	1909.84237	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	1907.15737	1909.83467	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	VN	NT	1907.15655	1909.83525	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	VL	NT	1907.15607	1909.83817	1850-1910	PASS

Band2	3MHz	16QAM	19185	15RB#0	VH	NT	1907.15814	1909.83814	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	1850.25479	1854.73519	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	1850.26014	1854.73374	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	1850.26282	1854.73222	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	VN	NT	1850.25828	1854.73468	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	1850.26064	1854.73334	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	1850.25927	1854.73147	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	1877.75718	1882.23028	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	1877.759	1882.2346	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	1877.76112	1882.23322	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	1877.76131	1882.23091	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	1877.76115	1882.23225	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	1877.76146	1882.23346	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	1905.25701	1909.73301	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	1905.26013	1909.73193	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	1905.25816	1909.73156	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	1905.25987	1909.72987	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	1905.26025	1909.73295	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	1905.25971	1909.73351	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	1850.53412	1859.46902	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	1850.52971	1859.46221	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	1850.53425	1859.46375	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	VN	NT	1850.53624	1859.45354	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	VL	NT	1850.54145	1859.45665	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	VH	NT	1850.53352	1859.45792	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	VN	NT	1875.53277	1884.46497	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	1875.53726	1884.46086	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	1875.52836	1884.45826	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	VN	NT	1875.53676	1884.46266	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	VL	NT	1875.53558	1884.45828	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	VH	NT	1875.54164	1884.45574	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	1900.52911	1909.44851	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	1900.52647	1909.45297	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	1900.52297	1909.45097	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	VN	NT	1900.53963	1909.45023	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	VL	NT	1900.53795	1909.46335	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	VH	NT	1900.53643	1909.45643	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	1850.8069	1864.2119	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	1850.81288	1864.18988	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	VH	NT	1850.79446	1864.20246	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	VN	NT	1850.81437	1864.19437	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	15MHz	16QAM	18675	75RB#0	VL	NT	1850.80695	1864.19195	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	VH	NT	1850.80777	1864.18977	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	1873.30027	1886.68227	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	VL	NT	1873.31291	1886.68591	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	1873.30008	1886.69508	1850-1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	VN	NT	1873.31317	1886.68017	1850-1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	VL	NT	1873.31989	1886.68489	1850-1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	VH	NT	1873.32063	1886.67163	1850-1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	1895.81459	1909.18259	1850-1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	1895.82628	1909.17228	1850-1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	1895.81405	1909.18905	1850-1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	VN	NT	1895.82317	1909.17917	1850-1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	VL	NT	1895.81333	1909.17933	1850-1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	VH	NT	1895.81787	1909.17187	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	VN	NT	1851.07914	1868.92014	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	VL	NT	1851.08967	1868.92567	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	VH	NT	1851.08906	1868.92806	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	VN	NT	1851.09037	1868.95637	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	VL	NT	1851.08027	1868.92027	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	VH	NT	1851.10242	1868.91042	1850-1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	1871.08735	1888.90835	1850-1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	VL	NT	1871.09213	1888.90313	1850-1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	VH	NT	1871.086	1888.91	1850-1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	VN	NT	1871.11031	1888.94331	1850-1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	VL	NT	1871.09611	1888.89411	1850-1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	VH	NT	1871.11121	1888.93421	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	VN	NT	1891.09804	1908.90404	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	VL	NT	1891.08976	1908.91976	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	VH	NT	1891.08779	1908.91479	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	VN	NT	1891.11623	1908.92823	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	VL	NT	1891.09793	1908.94493	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	VH	NT	1891.10481	1908.89081	1850-1910	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-30	1850.15745	1851.23745	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-20	1850.15688	1851.23718	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-10	1850.15613	1851.23823	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	0	1850.15788	1851.23688	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	10	1850.15642	1851.23692	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	1.4MHz	QPSK	18607	6RB#0	NV	20	1850.15587	1851.23667	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	30	1850.15656	1851.23796	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	40	1850.15677	1851.23757	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	50	1850.1583	1851.2376	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-30	1850.15566	1851.23616	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-20	1850.15738	1851.23668	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-10	1850.15768	1851.23758	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	0	1850.1562	1851.2361	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	10	1850.15739	1851.23789	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	20	1850.15892	1851.23862	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	30	1850.15517	1851.23697	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	40	1850.15879	1851.23809	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	50	1850.15584	1851.23574	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	1879.45679	1880.53829	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	1879.45811	1880.53791	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-10	1879.45895	1880.53785	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	1879.45895	1880.53865	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	1879.45868	1880.53848	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	1879.45789	1880.53669	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	30	1879.45957	1880.53777	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	40	1879.46002	1880.53812	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	50	1879.45629	1880.53789	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-30	1879.45564	1880.53804	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-20	1879.45691	1880.53761	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-10	1879.45755	1880.53945	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	0	1879.45671	1880.53751	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	10	1879.45605	1880.53935	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	20	1879.45681	1880.53671	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	30	1879.45734	1880.53844	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	40	1879.45638	1880.53568	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	50	1879.45588	1880.53788	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-30	1908.75792	1909.83492	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-20	1908.75771	1909.83791	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-10	1908.75699	1909.83949	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	0	1908.75729	1909.83649	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	10	1908.75699	1909.83599	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	20	1908.75694	1909.83494	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	30	1908.75841	1909.83521	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	40	1908.75771	1909.83811	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	50	1908.7574	1909.8365	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-30	1908.75878	1909.83898	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	1.4MHz	16QAM	19193	6RB#0	NV	-20	1908.75685	1909.83825	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-10	1908.75911	1909.83731	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	0	1908.75583	1909.83783	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	10	1908.75574	1909.83934	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	20	1908.76079	1909.83729	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	30	1908.75622	1909.83892	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	40	1908.76007	1909.83757	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	50	1908.75567	1909.83807	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-30	1850.15892	1852.84282	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-20	1850.15979	1852.84839	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-10	1850.15758	1852.84528	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	0	1850.15913	1852.84203	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	10	1850.1589	1852.8451	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	20	1850.15883	1852.84533	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	30	1850.15741	1852.84321	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	40	1850.15921	1852.83661	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	50	1850.15757	1852.83827	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-30	1850.15914	1852.83874	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-20	1850.15967	1852.83987	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-10	1850.1587	1852.8376	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	0	1850.15997	1852.83517	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	10	1850.15902	1852.84062	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	20	1850.15779	1852.83819	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	30	1850.15893	1852.83473	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	40	1850.1587	1852.8361	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	50	1850.15891	1852.83631	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-30	1878.65816	1881.33996	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-20	1878.65907	1881.34257	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-10	1878.65826	1881.34196	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	1878.6576	1881.3387	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	10	1878.65633	1881.34413	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	1878.65868	1881.34638	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	30	1878.65786	1881.34436	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	40	1878.66075	1881.34295	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	50	1878.66013	1881.34353	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-30	1878.6596	1881.3355	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-20	1878.6577	1881.3402	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-10	1878.65948	1881.33888	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	0	1878.65927	1881.33897	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	10	1878.65947	1881.33767	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	20	1878.65978	1881.33998	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	3MHz	16QAM	18900	15RB#0	NV	30	1878.66107	1881.33757	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	40	1878.6612	1881.3345	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	50	1878.65812	1881.33922	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-30	1907.15503	1909.83953	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-20	1907.15753	1909.84233	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-10	1907.15616	1909.83886	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	0	1907.15664	1909.84324	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	10	1907.15577	1909.84447	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	20	1907.1575	1909.8465	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	30	1907.15737	1909.83997	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	40	1907.15757	1909.84447	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	50	1907.15568	1909.84288	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-30	1907.15597	1909.83537	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-20	1907.15852	1909.84072	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-10	1907.15685	1909.83765	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	0	1907.16018	1909.83768	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	10	1907.15957	1909.83497	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	20	1907.15756	1909.83446	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	30	1907.15687	1909.83607	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	40	1907.15734	1909.83514	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	50	1907.15886	1909.83866	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-20	1850.26224	1854.73134	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-10	1850.26387	1854.73167	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	0	1850.25451	1854.73621	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	10	1850.25778	1854.73268	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	20	1850.25845	1854.73765	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	30	1850.25943	1854.73433	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	40	1850.25894	1854.73404	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	50	1850.25789	1854.73309	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-30	1850.26166	1854.73606	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-20	1850.25817	1854.73087	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-10	1850.2639	1854.7354	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	0	1850.25984	1854.73214	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	10	1850.25943	1854.73373	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	20	1850.26019	1854.73039	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	30	1850.26055	1854.73305	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	40	1850.25941	1854.73291	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	50	1850.25784	1854.73164	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	1877.75971	1882.23631	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	1877.75767	1882.23627	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-10	1877.7602	1882.2338	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	5MHz	QPSK	18900	25RB#0	NV	0	1877.76004	1882.23284	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	1877.76248	1882.23278	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	1877.75989	1882.23419	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	30	1877.75733	1882.23103	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	40	1877.75996	1882.23166	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	50	1877.75729	1882.23329	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-30	1877.75948	1882.22988	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-20	1877.76371	1882.23281	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-10	1877.76193	1882.23463	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	0	1877.75962	1882.23392	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	10	1877.76277	1882.23307	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	20	1877.76022	1882.23372	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	30	1877.76231	1882.23331	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	40	1877.75966	1882.23476	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	50	1877.76303	1882.23483	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-30	1905.25667	1909.73397	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-20	1905.25743	1909.72853	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-10	1905.25917	1909.72917	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	0	1905.26147	1909.73167	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	10	1905.25479	1909.73179	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	20	1905.25646	1909.73646	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	30	1905.25335	1909.72915	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	40	1905.257	1909.7289	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	50	1905.26056	1909.73256	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-30	1905.25729	1909.73049	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-20	1905.26194	1909.72994	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-10	1905.25849	1909.73409	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	0	1905.2559	1909.7318	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	10	1905.26094	1909.73434	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	20	1905.25898	1909.73228	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	30	1905.26248	1909.72918	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	40	1905.2609	1909.7304	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	50	1905.26029	1909.73379	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-30	1850.53589	1859.46829	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-20	1850.5343	1859.4599	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-10	1850.53464	1859.46364	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	0	1850.53621	1859.46401	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	10	1850.53132	1859.46112	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	20	1850.53551	1859.45851	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	30	1850.53367	1859.45537	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	40	1850.53107	1859.45837	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	10MHz	QPSK	18650	50RB#0	NV	50	1850.53065	1859.46455	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-30	1850.53336	1859.46216	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-20	1850.53682	1859.45902	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-10	1850.54428	1859.46328	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	0	1850.53467	1859.45727	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	10	1850.53913	1859.46393	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	20	1850.54122	1859.46152	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	30	1850.53942	1859.46732	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	40	1850.53285	1859.45685	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	50	1850.53638	1859.46458	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	1875.52784	1884.45984	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-20	1875.53394	1884.45624	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-10	1875.54243	1884.45993	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	1875.53737	1884.46097	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	1875.52943	1884.45943	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	1875.5322	1884.4612	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	30	1875.53964	1884.46864	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	40	1875.53482	1884.46472	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	50	1875.53185	1884.46025	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-30	1875.54349	1884.46029	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-20	1875.53566	1884.45996	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-10	1875.54481	1884.46691	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	0	1875.54449	1884.46179	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	10	1875.53826	1884.45666	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	20	1875.53646	1884.46446	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	30	1875.54368	1884.45408	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	40	1875.53522	1884.45722	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	50	1875.53402	1884.46172	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-30	1900.53009	1909.44659	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-20	1900.536	1909.4497	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-10	1900.5278	1909.4602	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	0	1900.53584	1909.45834	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	10	1900.53345	1909.45625	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	20	1900.53414	1909.45204	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	30	1900.53991	1909.44551	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	40	1900.53278	1909.45948	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	50	1900.53515	1909.44925	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-30	1900.53189	1909.45579	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-20	1900.53361	1909.44791	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-10	1900.53834	1909.45184	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	0	1900.54059	1909.45069	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	10MHz	16QAM	19150	50RB#0	NV	10	1900.53257	1909.45307	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	20	1900.5362	1909.4473	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	30	1900.53627	1909.45697	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	40	1900.5367	1909.457	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	50	1900.54019	1909.44679	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-30	1850.80451	1864.19851	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-20	1850.79852	1864.18852	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-10	1850.80357	1864.20357	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	0	1850.79929	1864.19829	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	10	1850.81291	1864.20191	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	20	1850.8147	1864.2057	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	30	1850.79997	1864.18897	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	40	1850.79398	1864.19498	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	50	1850.81054	1864.18654	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-30	1850.80213	1864.19113	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-20	1850.80571	1864.18871	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-10	1850.80502	1864.17602	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	0	1850.81161	1864.17861	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	10	1850.80548	1864.18348	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	20	1850.80499	1864.19099	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	30	1850.80084	1864.18184	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	40	1850.81906	1864.18206	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	50	1850.81052	1864.19652	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-30	1873.30262	1886.68562	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-20	1873.31029	1886.68029	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-10	1873.30818	1886.67718	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	0	1873.30684	1886.68584	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	10	1873.30142	1886.68942	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	20	1873.30774	1886.68774	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	30	1873.30209	1886.68809	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	40	1873.31853	1886.68553	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	50	1873.3097	1886.6797	1850-1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-30	1873.30463	1886.66963	1850-1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-20	1873.31542	1886.67342	1850-1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-10	1873.31943	1886.67043	1850-1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	0	1873.30474	1886.68774	1850-1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	10	1873.32128	1886.68228	1850-1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	20	1873.31363	1886.67263	1850-1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	30	1873.30324	1886.67324	1850-1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	40	1873.31177	1886.67577	1850-1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	50	1873.3164	1886.6864	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	15MHz	QPSK	19125	75RB#0	NV	-30	1895.81103	1909.18503	1850-1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-20	1895.82211	1909.18811	1850-1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-10	1895.80718	1909.17418	1850-1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	0	1895.81426	1909.18726	1850-1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	10	1895.81003	1909.16903	1850-1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	20	1895.80321	1909.18221	1850-1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	30	1895.79881	1909.18381	1850-1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	40	1895.80961	1909.17961	1850-1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	50	1895.82486	1909.18586	1850-1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-30	1895.81096	1909.17096	1850-1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-20	1895.81845	1909.19245	1850-1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-10	1895.8127	1909.1897	1850-1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	0	1895.81248	1909.16248	1850-1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	10	1895.81933	1909.17133	1850-1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	20	1895.81711	1909.18411	1850-1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	30	1895.81208	1909.18208	1850-1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	40	1895.81937	1909.17437	1850-1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	50	1895.8129	1909.1789	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-30	1851.09744	1868.93144	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-20	1851.0735	1868.9315	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-10	1851.07501	1868.91101	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	0	1851.09606	1868.92406	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	10	1851.0812	1868.9262	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	20	1851.07774	1868.91674	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	30	1851.07806	1868.93206	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	40	1851.08324	1868.93924	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	50	1851.10245	1868.91545	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-30	1851.09843	1868.95543	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-20	1851.08812	1868.94312	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-10	1851.10402	1868.93902	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	0	1851.09433	1868.95733	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	10	1851.10382	1868.95882	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	20	1851.09007	1868.97307	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	30	1851.09837	1868.92337	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	40	1851.10098	1868.96498	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	50	1851.09573	1868.93973	1850-1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-30	1871.08957	1888.88657	1850-1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-20	1871.0781	1888.9121	1850-1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-10	1871.10716	1888.91416	1850-1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	0	1871.09392	1888.89392	1850-1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	10	1871.10762	1888.89362	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	20MHz	QPSK	18900	100RB#0	NV	20	1871.09921	1888.89821	1850-1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	30	1871.09371	1888.91271	1850-1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	40	1871.11062	1888.92462	1850-1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	50	1871.13011	1888.91111	1850-1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-30	1871.11148	1888.92648	1850-1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-20	1871.10099	1888.93499	1850-1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-10	1871.1011	1888.9231	1850-1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	0	1871.11336	1888.94536	1850-1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	10	1871.11489	1888.88189	1850-1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	20	1871.11704	1888.95504	1850-1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	30	1871.09853	1888.89153	1850-1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	40	1871.09973	1888.89773	1850-1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	50	1871.10583	1888.91683	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-30	1891.07674	1908.91074	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-20	1891.07685	1908.91885	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-10	1891.09791	1908.92391	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	0	1891.09337	1908.90237	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	10	1891.0939	1908.8849	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	20	1891.09365	1908.90265	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	30	1891.06825	1908.90125	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	40	1891.10375	1908.91475	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	50	1891.10892	1908.91292	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-30	1891.08991	1908.89691	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-20	1891.09252	1908.87652	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-10	1891.09512	1908.93812	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	0	1891.09875	1908.92975	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	10	1891.10041	1908.94741	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	20	1891.09814	1908.89614	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	30	1891.08793	1908.93193	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	40	1891.09212	1908.91812	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	50	1891.10493	1908.90893	1850-1910	PASS

---END---