

Appendix Test Data

Report No:	1812C60124812505-06	Test Sample NO:	1-2-2
Start Test Date:	2026-03-05	Finish Test Date:	2026-03-18
Test Engineer:	<i>Biangfei Yang</i>	Auditor:	<i>Justin Feng</i>
Temperature:	25.3°C	Relative Humidity:	44%
Pressure:	101 kPa		



Appendix A: Conducted Output Power

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Power(dBm)	Verdict
Band66	1.4MHz	QPSK	131979	1RB#0	23.93	PASS
Band66	1.4MHz	QPSK	131979	1RB#2	24.27	PASS
Band66	1.4MHz	QPSK	131979	1RB#5	24.12	PASS
Band66	1.4MHz	QPSK	131979	3RB#0	24.03	PASS
Band66	1.4MHz	QPSK	131979	3RB#1	23.98	PASS
Band66	1.4MHz	QPSK	131979	3RB#3	23.84	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	22.79	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	23.58	PASS
Band66	1.4MHz	16QAM	131979	1RB#2	22.94	PASS
Band66	1.4MHz	16QAM	131979	1RB#5	23.40	PASS
Band66	1.4MHz	16QAM	131979	3RB#0	22.84	PASS
Band66	1.4MHz	16QAM	131979	3RB#1	22.54	PASS
Band66	1.4MHz	16QAM	131979	3RB#3	22.70	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	21.82	PASS
Band66	1.4MHz	QPSK	132322	1RB#0	24.06	PASS
Band66	1.4MHz	QPSK	132322	1RB#2	23.88	PASS
Band66	1.4MHz	QPSK	132322	1RB#5	23.99	PASS
Band66	1.4MHz	QPSK	132322	3RB#0	23.96	PASS
Band66	1.4MHz	QPSK	132322	3RB#1	23.98	PASS
Band66	1.4MHz	QPSK	132322	3RB#3	23.62	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	22.77	PASS
Band66	1.4MHz	16QAM	132322	1RB#0	22.86	PASS
Band66	1.4MHz	16QAM	132322	1RB#2	23.68	PASS
Band66	1.4MHz	16QAM	132322	1RB#5	22.81	PASS
Band66	1.4MHz	16QAM	132322	3RB#0	22.68	PASS
Band66	1.4MHz	16QAM	132322	3RB#1	22.77	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	1.4MHz	16QAM	132322	3RB#3	22.39	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	21.92	PASS
Band66	1.4MHz	QPSK	132665	1RB#0	23.76	PASS
Band66	1.4MHz	QPSK	132665	1RB#2	23.79	PASS
Band66	1.4MHz	QPSK	132665	1RB#5	24.26	PASS
Band66	1.4MHz	QPSK	132665	3RB#0	23.99	PASS
Band66	1.4MHz	QPSK	132665	3RB#1	24.09	PASS
Band66	1.4MHz	QPSK	132665	3RB#3	23.92	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	22.95	PASS
Band66	1.4MHz	16QAM	132665	1RB#0	22.46	PASS
Band66	1.4MHz	16QAM	132665	1RB#2	24.23	PASS
Band66	1.4MHz	16QAM	132665	1RB#5	23.34	PASS
Band66	1.4MHz	16QAM	132665	3RB#0	23.05	PASS
Band66	1.4MHz	16QAM	132665	3RB#1	22.76	PASS
Band66	1.4MHz	16QAM	132665	3RB#3	22.95	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	21.84	PASS
Band66	3MHz	QPSK	131987	1RB#0	24.56	PASS
Band66	3MHz	QPSK	131987	1RB#8	24.29	PASS
Band66	3MHz	QPSK	131987	1RB#14	24.10	PASS
Band66	3MHz	QPSK	131987	8RB#0	23.13	PASS
Band66	3MHz	QPSK	131987	8RB#4	23.18	PASS
Band66	3MHz	QPSK	131987	8RB#7	22.95	PASS
Band66	3MHz	QPSK	131987	15RB#0	23.03	PASS
Band66	3MHz	16QAM	131987	1RB#0	23.58	PASS
Band66	3MHz	16QAM	131987	1RB#8	23.63	PASS
Band66	3MHz	16QAM	131987	1RB#14	22.92	PASS
Band66	3MHz	16QAM	131987	8RB#0	22.37	PASS
Band66	3MHz	16QAM	131987	8RB#4	22.18	PASS
Band66	3MHz	16QAM	131987	8RB#7	22.07	PASS
Band66	3MHz	16QAM	131987	15RB#0	21.96	PASS
Band66	3MHz	QPSK	132322	1RB#0	24.19	PASS
Band66	3MHz	QPSK	132322	1RB#8	24.05	PASS
Band66	3MHz	QPSK	132322	1RB#14	24.06	PASS
Band66	3MHz	QPSK	132322	8RB#0	23.00	PASS
Band66	3MHz	QPSK	132322	8RB#4	23.16	PASS
Band66	3MHz	QPSK	132322	8RB#7	22.94	PASS
Band66	3MHz	QPSK	132322	15RB#0	23.00	PASS
Band66	3MHz	16QAM	132322	1RB#0	23.19	PASS
Band66	3MHz	16QAM	132322	1RB#8	23.38	PASS
Band66	3MHz	16QAM	132322	1RB#14	23.11	PASS
Band66	3MHz	16QAM	132322	8RB#0	22.14	PASS
Band66	3MHz	16QAM	132322	8RB#4	22.14	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	3MHz	16QAM	132322	8RB#7	21.98	PASS
Band66	3MHz	16QAM	132322	15RB#0	22.04	PASS
Band66	3MHz	QPSK	132657	1RB#0	24.60	PASS
Band66	3MHz	QPSK	132657	1RB#8	24.28	PASS
Band66	3MHz	QPSK	132657	1RB#14	24.16	PASS
Band66	3MHz	QPSK	132657	8RB#0	23.16	PASS
Band66	3MHz	QPSK	132657	8RB#4	23.20	PASS
Band66	3MHz	QPSK	132657	8RB#7	23.11	PASS
Band66	3MHz	QPSK	132657	15RB#0	23.01	PASS
Band66	3MHz	16QAM	132657	1RB#0	23.41	PASS
Band66	3MHz	16QAM	132657	1RB#8	23.92	PASS
Band66	3MHz	16QAM	132657	1RB#14	23.27	PASS
Band66	3MHz	16QAM	132657	8RB#0	22.20	PASS
Band66	3MHz	16QAM	132657	8RB#4	22.11	PASS
Band66	3MHz	16QAM	132657	8RB#7	22.15	PASS
Band66	3MHz	16QAM	132657	15RB#0	21.95	PASS
Band66	5MHz	QPSK	131997	1RB#0	24.46	PASS
Band66	5MHz	QPSK	131997	1RB#12	24.55	PASS
Band66	5MHz	QPSK	131997	1RB#24	24.15	PASS
Band66	5MHz	QPSK	131997	12RB#0	23.22	PASS
Band66	5MHz	QPSK	131997	12RB#6	23.12	PASS
Band66	5MHz	QPSK	131997	12RB#13	23.00	PASS
Band66	5MHz	QPSK	131997	25RB#0	23.00	PASS
Band66	5MHz	16QAM	131997	1RB#0	23.56	PASS
Band66	5MHz	16QAM	131997	1RB#12	23.77	PASS
Band66	5MHz	16QAM	131997	1RB#24	23.34	PASS
Band66	5MHz	16QAM	131997	12RB#0	22.21	PASS
Band66	5MHz	16QAM	131997	12RB#6	22.10	PASS
Band66	5MHz	16QAM	131997	12RB#13	22.07	PASS
Band66	5MHz	16QAM	131997	25RB#0	21.99	PASS
Band66	5MHz	QPSK	132322	1RB#0	24.33	PASS
Band66	5MHz	QPSK	132322	1RB#12	24.26	PASS
Band66	5MHz	QPSK	132322	1RB#24	23.98	PASS
Band66	5MHz	QPSK	132322	12RB#0	23.09	PASS
Band66	5MHz	QPSK	132322	12RB#6	23.05	PASS
Band66	5MHz	QPSK	132322	12RB#13	22.97	PASS
Band66	5MHz	QPSK	132322	25RB#0	22.92	PASS
Band66	5MHz	16QAM	132322	1RB#0	23.13	PASS
Band66	5MHz	16QAM	132322	1RB#12	22.89	PASS
Band66	5MHz	16QAM	132322	1RB#24	22.85	PASS
Band66	5MHz	16QAM	132322	12RB#0	22.09	PASS
Band66	5MHz	16QAM	132322	12RB#6	22.21	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	5MHz	16QAM	132322	12RB#13	21.88	PASS
Band66	5MHz	16QAM	132322	25RB#0	21.94	PASS
Band66	5MHz	QPSK	132647	1RB#0	24.14	PASS
Band66	5MHz	QPSK	132647	1RB#12	24.85	PASS
Band66	5MHz	QPSK	132647	1RB#24	24.21	PASS
Band66	5MHz	QPSK	132647	12RB#0	23.15	PASS
Band66	5MHz	QPSK	132647	12RB#6	23.24	PASS
Band66	5MHz	QPSK	132647	12RB#13	23.20	PASS
Band66	5MHz	QPSK	132647	25RB#0	23.08	PASS
Band66	5MHz	16QAM	132647	1RB#0	22.96	PASS
Band66	5MHz	16QAM	132647	1RB#12	23.29	PASS
Band66	5MHz	16QAM	132647	1RB#24	23.23	PASS
Band66	5MHz	16QAM	132647	12RB#0	22.06	PASS
Band66	5MHz	16QAM	132647	12RB#6	22.26	PASS
Band66	5MHz	16QAM	132647	12RB#13	22.00	PASS
Band66	5MHz	16QAM	132647	25RB#0	22.10	PASS
Band66	10MHz	QPSK	132022	1RB#0	24.18	PASS
Band66	10MHz	QPSK	132022	1RB#24	24.33	PASS
Band66	10MHz	QPSK	132022	1RB#49	23.98	PASS
Band66	10MHz	QPSK	132022	25RB#0	23.07	PASS
Band66	10MHz	QPSK	132022	25RB#12	22.95	PASS
Band66	10MHz	QPSK	132022	25RB#25	23.03	PASS
Band66	10MHz	QPSK	132022	50RB#0	22.91	PASS
Band66	10MHz	16QAM	132022	1RB#0	23.27	PASS
Band66	10MHz	16QAM	132022	1RB#24	23.54	PASS
Band66	10MHz	16QAM	132022	1RB#49	23.12	PASS
Band66	10MHz	16QAM	132022	25RB#0	22.07	PASS
Band66	10MHz	16QAM	132022	25RB#12	22.08	PASS
Band66	10MHz	16QAM	132022	25RB#25	22.02	PASS
Band66	10MHz	16QAM	132022	50RB#0	22.43	PASS
Band66	10MHz	QPSK	132322	1RB#0	24.59	PASS
Band66	10MHz	QPSK	132322	1RB#24	24.56	PASS
Band66	10MHz	QPSK	132322	1RB#49	24.24	PASS
Band66	10MHz	QPSK	132322	25RB#0	23.44	PASS
Band66	10MHz	QPSK	132322	25RB#12	23.18	PASS
Band66	10MHz	QPSK	132322	25RB#25	23.09	PASS
Band66	10MHz	QPSK	132322	50RB#0	23.09	PASS
Band66	10MHz	16QAM	132322	1RB#0	23.49	PASS
Band66	10MHz	16QAM	132322	1RB#24	23.98	PASS
Band66	10MHz	16QAM	132322	1RB#49	23.12	PASS
Band66	10MHz	16QAM	132322	25RB#0	22.41	PASS
Band66	10MHz	16QAM	132322	25RB#12	22.18	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	10MHz	16QAM	132322	25RB#25	22.08	PASS
Band66	10MHz	16QAM	132322	50RB#0	22.17	PASS
Band66	10MHz	QPSK	132622	1RB#0	23.99	PASS
Band66	10MHz	QPSK	132622	1RB#24	24.31	PASS
Band66	10MHz	QPSK	132622	1RB#49	23.88	PASS
Band66	10MHz	QPSK	132622	25RB#0	22.87	PASS
Band66	10MHz	QPSK	132622	25RB#12	22.97	PASS
Band66	10MHz	QPSK	132622	25RB#25	22.98	PASS
Band66	10MHz	QPSK	132622	50RB#0	22.92	PASS
Band66	10MHz	16QAM	132622	1RB#0	22.64	PASS
Band66	10MHz	16QAM	132622	1RB#24	23.85	PASS
Band66	10MHz	16QAM	132622	1RB#49	22.75	PASS
Band66	10MHz	16QAM	132622	25RB#0	22.02	PASS
Band66	10MHz	16QAM	132622	25RB#12	22.10	PASS
Band66	10MHz	16QAM	132622	25RB#25	21.93	PASS
Band66	10MHz	16QAM	132622	50RB#0	21.85	PASS
Band66	15MHz	QPSK	132047	1RB#0	24.29	PASS
Band66	15MHz	QPSK	132047	1RB#38	24.28	PASS
Band66	15MHz	QPSK	132047	1RB#74	24.03	PASS
Band66	15MHz	QPSK	132047	38RB#0	22.86	PASS
Band66	15MHz	QPSK	132047	38RB#18	22.97	PASS
Band66	15MHz	QPSK	132047	38RB#37	23.28	PASS
Band66	15MHz	QPSK	132047	75RB#0	23.24	PASS
Band66	15MHz	16QAM	132047	1RB#0	23.13	PASS
Band66	15MHz	16QAM	132047	1RB#38	23.57	PASS
Band66	15MHz	16QAM	132047	1RB#74	22.85	PASS
Band66	15MHz	16QAM	132047	38RB#0	22.86	PASS
Band66	15MHz	16QAM	132047	38RB#18	21.87	PASS
Band66	15MHz	16QAM	132047	38RB#37	23.10	PASS
Band66	15MHz	16QAM	132047	75RB#0	22.10	PASS
Band66	15MHz	QPSK	132322	1RB#0	24.24	PASS
Band66	15MHz	QPSK	132322	1RB#38	24.20	PASS
Band66	15MHz	QPSK	132322	1RB#74	23.86	PASS
Band66	15MHz	QPSK	132322	38RB#0	23.01	PASS
Band66	15MHz	QPSK	132322	38RB#18	23.06	PASS
Band66	15MHz	QPSK	132322	38RB#37	22.87	PASS
Band66	15MHz	QPSK	132322	75RB#0	22.93	PASS
Band66	15MHz	16QAM	132322	1RB#0	23.19	PASS
Band66	15MHz	16QAM	132322	1RB#38	23.49	PASS
Band66	15MHz	16QAM	132322	1RB#74	22.93	PASS
Band66	15MHz	16QAM	132322	38RB#0	22.98	PASS
Band66	15MHz	16QAM	132322	38RB#18	21.88	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	15MHz	16QAM	132322	38RB#37	22.77	PASS
Band66	15MHz	16QAM	132322	75RB#0	21.83	PASS
Band66	15MHz	QPSK	132597	1RB#0	23.67	PASS
Band66	15MHz	QPSK	132597	1RB#38	23.86	PASS
Band66	15MHz	QPSK	132597	1RB#74	23.65	PASS
Band66	15MHz	QPSK	132597	38RB#0	22.64	PASS
Band66	15MHz	QPSK	132597	38RB#18	23.44	PASS
Band66	15MHz	QPSK	132597	38RB#37	22.82	PASS
Band66	15MHz	QPSK	132597	75RB#0	23.14	PASS
Band66	15MHz	16QAM	132597	1RB#0	22.52	PASS
Band66	15MHz	16QAM	132597	1RB#38	23.55	PASS
Band66	15MHz	16QAM	132597	1RB#74	22.66	PASS
Band66	15MHz	16QAM	132597	38RB#0	22.57	PASS
Band66	15MHz	16QAM	132597	38RB#18	22.29	PASS
Band66	15MHz	16QAM	132597	38RB#37	23.24	PASS
Band66	15MHz	16QAM	132597	75RB#0	22.01	PASS
Band66	20MHz	QPSK	132072	1RB#0	24.26	PASS
Band66	20MHz	QPSK	132072	1RB#49	24.13	PASS
Band66	20MHz	QPSK	132072	1RB#99	24.01	PASS
Band66	20MHz	QPSK	132072	50RB#0	22.86	PASS
Band66	20MHz	QPSK	132072	50RB#25	22.88	PASS
Band66	20MHz	QPSK	132072	50RB#50	22.88	PASS
Band66	20MHz	QPSK	132072	100RB#0	22.76	PASS
Band66	20MHz	16QAM	132072	1RB#0	23.10	PASS
Band66	20MHz	16QAM	132072	1RB#49	23.36	PASS
Band66	20MHz	16QAM	132072	1RB#99	22.98	PASS
Band66	20MHz	16QAM	132072	50RB#0	21.88	PASS
Band66	20MHz	16QAM	132072	50RB#25	21.92	PASS
Band66	20MHz	16QAM	132072	50RB#50	21.79	PASS
Band66	20MHz	16QAM	132072	100RB#0	21.76	PASS
Band66	20MHz	QPSK	132322	1RB#0	24.22	PASS
Band66	20MHz	QPSK	132322	1RB#49	24.04	PASS
Band66	20MHz	QPSK	132322	1RB#99	24.08	PASS
Band66	20MHz	QPSK	132322	50RB#0	23.15	PASS
Band66	20MHz	QPSK	132322	50RB#25	23.18	PASS
Band66	20MHz	QPSK	132322	50RB#50	22.86	PASS
Band66	20MHz	QPSK	132322	100RB#0	22.98	PASS
Band66	20MHz	16QAM	132322	1RB#0	23.29	PASS
Band66	20MHz	16QAM	132322	1RB#49	23.52	PASS
Band66	20MHz	16QAM	132322	1RB#99	23.01	PASS
Band66	20MHz	16QAM	132322	50RB#0	22.23	PASS
Band66	20MHz	16QAM	132322	50RB#25	22.07	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	20MHz	16QAM	132322	50RB#50	21.89	PASS
Band66	20MHz	16QAM	132322	100RB#0	21.97	PASS
Band66	20MHz	QPSK	132572	1RB#0	24.01	PASS
Band66	20MHz	QPSK	132572	1RB#49	23.87	PASS
Band66	20MHz	QPSK	132572	1RB#99	23.72	PASS
Band66	20MHz	QPSK	132572	50RB#0	22.69	PASS
Band66	20MHz	QPSK	132572	50RB#25	22.69	PASS
Band66	20MHz	QPSK	132572	50RB#50	22.72	PASS
Band66	20MHz	QPSK	132572	100RB#0	22.57	PASS
Band66	20MHz	16QAM	132572	1RB#0	23.22	PASS
Band66	20MHz	16QAM	132572	1RB#49	22.77	PASS
Band66	20MHz	16QAM	132572	1RB#99	23.35	PASS
Band66	20MHz	16QAM	132572	50RB#0	21.67	PASS
Band66	20MHz	16QAM	132572	50RB#25	21.56	PASS
Band66	20MHz	16QAM	132572	50RB#50	21.76	PASS
Band66	20MHz	16QAM	132572	100RB#0	21.59	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band66	1.4MHz	QPSK	131979	1RB#0	4.33	13	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	5.07	13	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	5.44	13	PASS
Band66	1.4MHz	QPSK	132322	1RB#0	4.39	13	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	4.99	13	PASS
Band66	1.4MHz	16QAM	132322	1RB#0	5.11	13	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	5.87	13	PASS
Band66	1.4MHz	QPSK	132665	1RB#0	4.41	13	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	5.09	13	PASS
Band66	1.4MHz	16QAM	132665	1RB#0	5.32	13	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	6.00	13	PASS
Band66	3MHz	QPSK	131987	1RB#0	4.43	13	PASS
Band66	3MHz	QPSK	131987	15RB#0	6.89	13	PASS
Band66	3MHz	16QAM	131987	1RB#0	5.34	13	PASS
Band66	3MHz	16QAM	131987	15RB#0	5.99	13	PASS
Band66	3MHz	QPSK	132322	1RB#0	4.35	13	PASS
Band66	3MHz	QPSK	132322	15RB#0	5.15	13	PASS
Band66	3MHz	16QAM	132322	1RB#0	5.29	13	PASS
Band66	3MHz	16QAM	132322	15RB#0	5.97	13	PASS
Band66	3MHz	QPSK	132657	1RB#0	4.48	13	PASS
Band66	3MHz	QPSK	132657	15RB#0	5.24	13	PASS
Band66	3MHz	16QAM	132657	1RB#0	5.45	13	PASS
Band66	3MHz	16QAM	132657	15RB#0	6.05	13	PASS
Band66	5MHz	QPSK	131997	1RB#0	4.38	13	PASS
Band66	5MHz	QPSK	131997	25RB#0	5.19	13	PASS
Band66	5MHz	16QAM	131997	1RB#0	5.30	13	PASS
Band66	5MHz	16QAM	131997	25RB#0	5.98	13	PASS
Band66	5MHz	QPSK	132322	1RB#0	4.36	13	PASS
Band66	5MHz	QPSK	132322	25RB#0	5.15	13	PASS
Band66	5MHz	16QAM	132322	1RB#0	5.30	13	PASS
Band66	5MHz	16QAM	132322	25RB#0	5.93	13	PASS
Band66	5MHz	QPSK	132647	1RB#0	4.41	13	PASS
Band66	5MHz	QPSK	132647	25RB#0	5.18	13	PASS
Band66	5MHz	16QAM	132647	1RB#0	5.40	13	PASS
Band66	5MHz	16QAM	132647	25RB#0	5.98	13	PASS
Band66	10MHz	QPSK	132022	1RB#0	4.36	13	PASS
Band66	10MHz	QPSK	132022	50RB#0	5.14	13	PASS


Shenzhen Anbotek Compliance Laboratory Limited









Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	10MHz	16QAM	132022	1RB#0	5.26	13	PASS
Band66	10MHz	16QAM	132022	50RB#0	5.94	13	PASS
Band66	10MHz	QPSK	132322	1RB#0	4.28	13	PASS
Band66	10MHz	QPSK	132322	50RB#0	5.04	13	PASS
Band66	10MHz	16QAM	132322	1RB#0	5.19	13	PASS
Band66	10MHz	16QAM	132322	50RB#0	5.86	13	PASS
Band66	10MHz	QPSK	132622	1RB#0	4.34	13	PASS
Band66	10MHz	QPSK	132622	50RB#0	5.12	13	PASS
Band66	10MHz	16QAM	132622	1RB#0	5.41	13	PASS
Band66	10MHz	16QAM	132622	50RB#0	5.95	13	PASS
Band66	15MHz	QPSK	132047	1RB#0	4.38	13	PASS
Band66	15MHz	QPSK	132047	75RB#0	5.32	13	PASS
Band66	15MHz	16QAM	132047	1RB#0	5.23	13	PASS
Band66	15MHz	16QAM	132047	75RB#0	6.03	13	PASS
Band66	15MHz	QPSK	132322	1RB#0	4.46	13	PASS
Band66	15MHz	QPSK	132322	75RB#0	5.19	13	PASS
Band66	15MHz	16QAM	132322	1RB#0	5.34	13	PASS
Band66	15MHz	16QAM	132322	75RB#0	7.51	13	PASS
Band66	15MHz	QPSK	132597	1RB#0	4.29	13	PASS
Band66	15MHz	QPSK	132597	75RB#0	5.22	13	PASS
Band66	15MHz	16QAM	132597	1RB#0	5.14	13	PASS
Band66	15MHz	16QAM	132597	75RB#0	5.97	13	PASS
Band66	20MHz	QPSK	132072	1RB#0	4.32	13	PASS
Band66	20MHz	QPSK	132072	100RB#0	5.14	13	PASS
Band66	20MHz	16QAM	132072	1RB#0	5.23	13	PASS
Band66	20MHz	16QAM	132072	100RB#0	5.97	13	PASS
Band66	20MHz	QPSK	132322	1RB#0	4.49	13	PASS
Band66	20MHz	QPSK	132322	100RB#0	5.00	13	PASS
Band66	20MHz	16QAM	132322	1RB#0	5.42	13	PASS
Band66	20MHz	16QAM	132322	100RB#0	8.40	13	PASS
Band66	20MHz	QPSK	132572	1RB#0	4.13	13	PASS
Band66	20MHz	QPSK	132572	100RB#0	5.05	13	PASS
Band66	20MHz	16QAM	132572	1RB#0	5.01	13	PASS
Band66	20MHz	16QAM	132572	100RB#0	5.87	13	PASS


Test Graphs

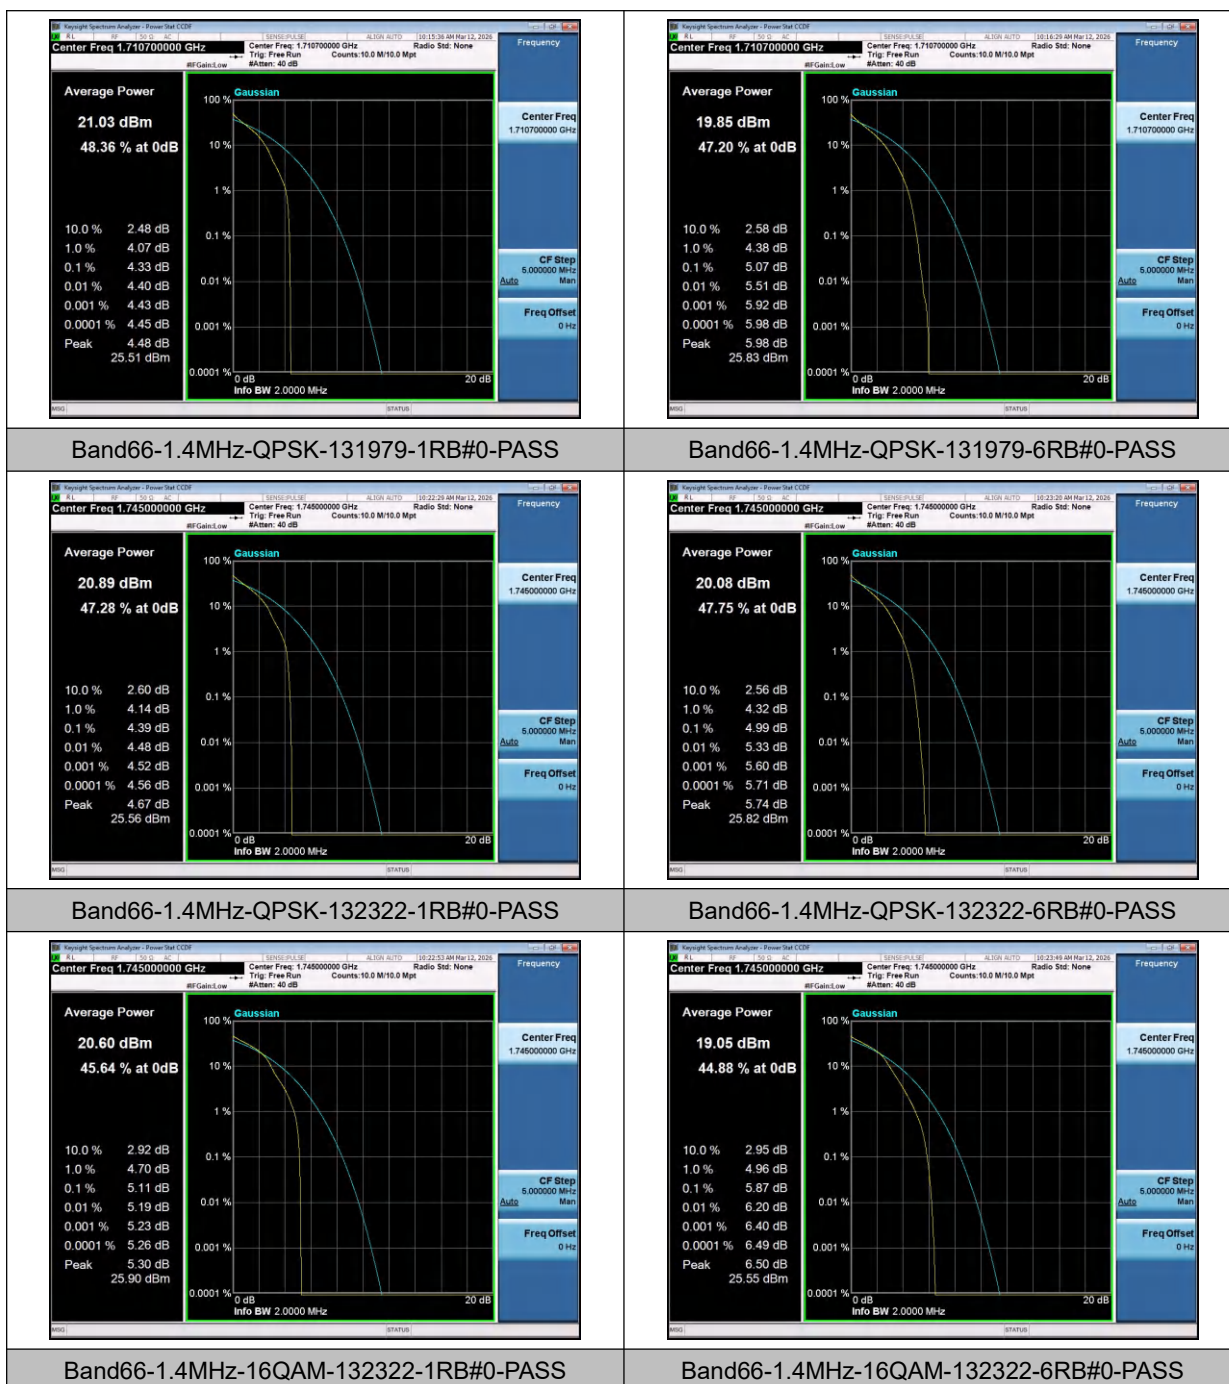

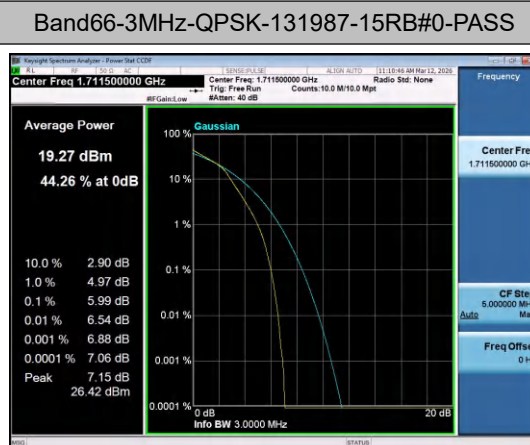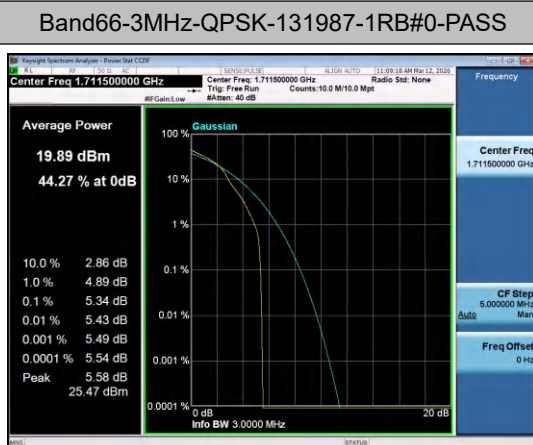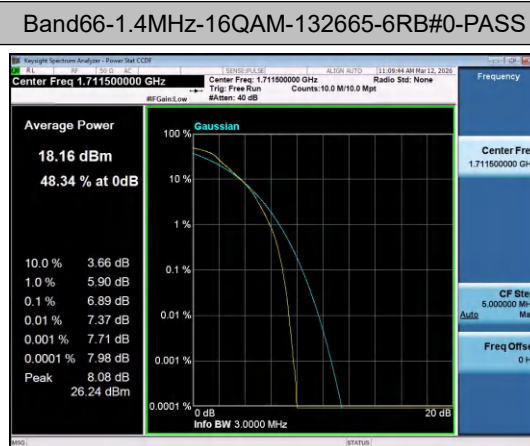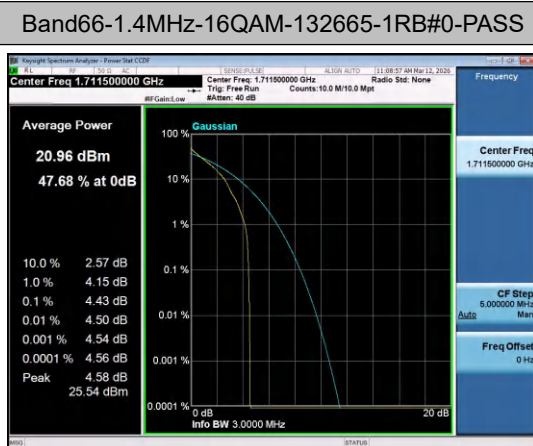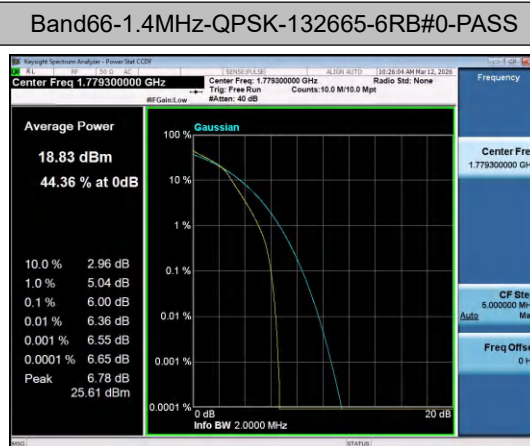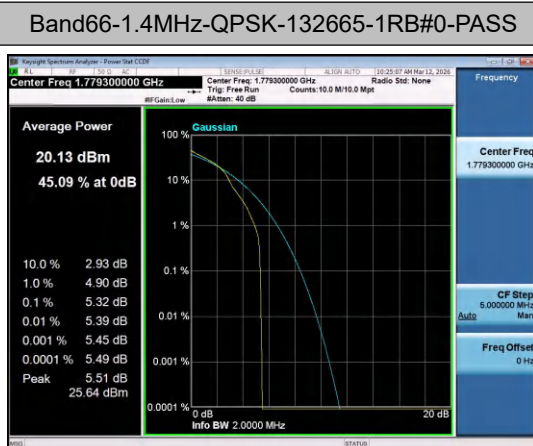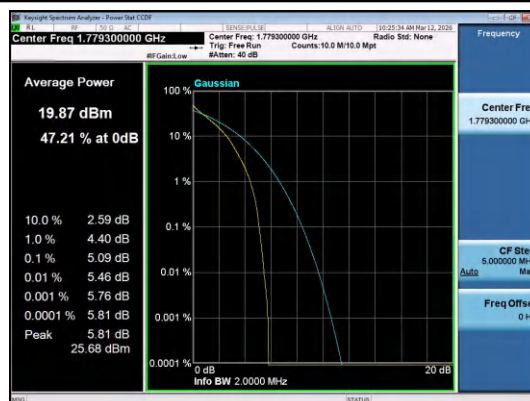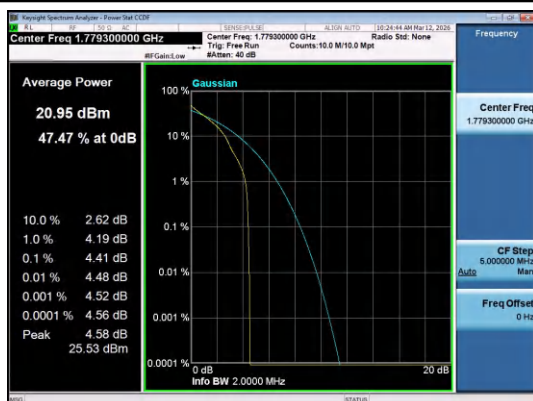


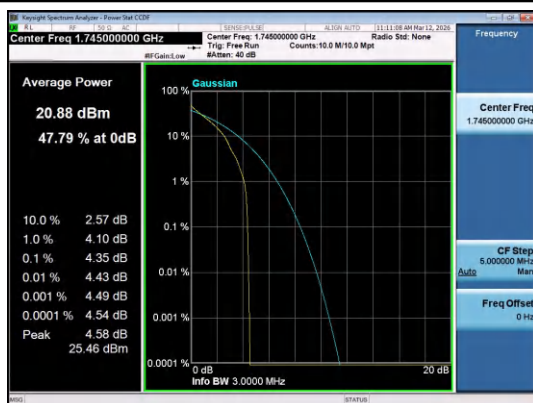


Band66-3MHz-QPSK-132322-1RB#0-PASS

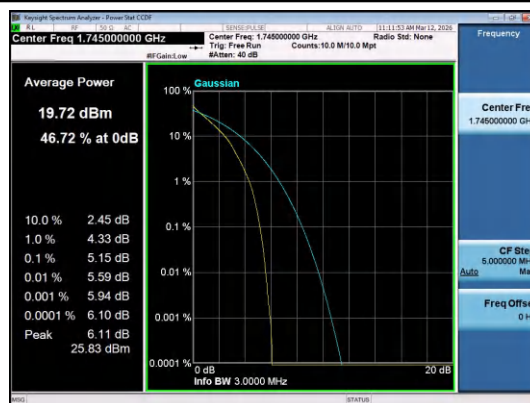


Band66-3MHz-QPSK-132322-15RB#0-PASS

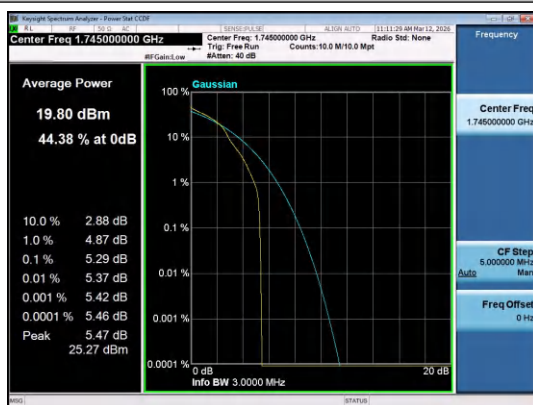


Band66-3MHz-16QAM-132322-1RB#0-PASS

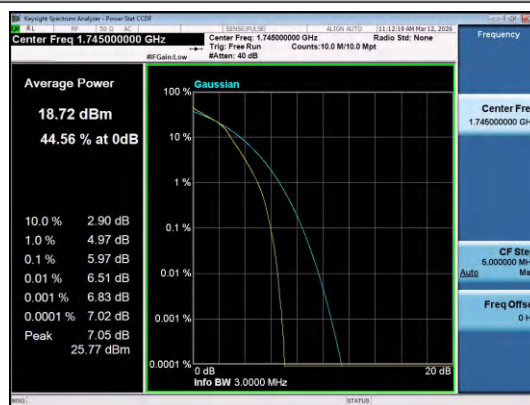


Band66-3MHz-16QAM-132322-15RB#0-PASS

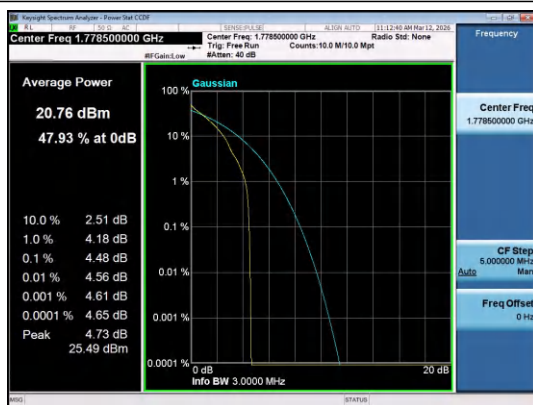

Band66-3MHz-QPSK-132657-1RB#0-PASS

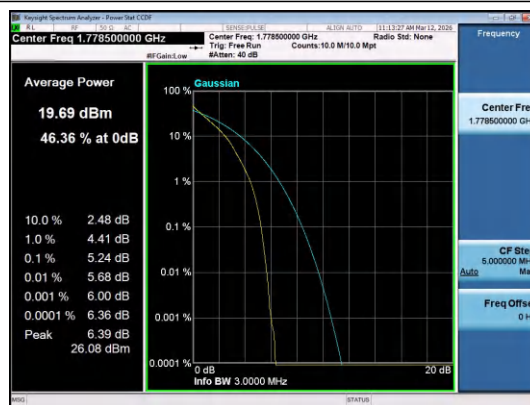


Band66-3MHz-QPSK-132657-15RB#0-PASS

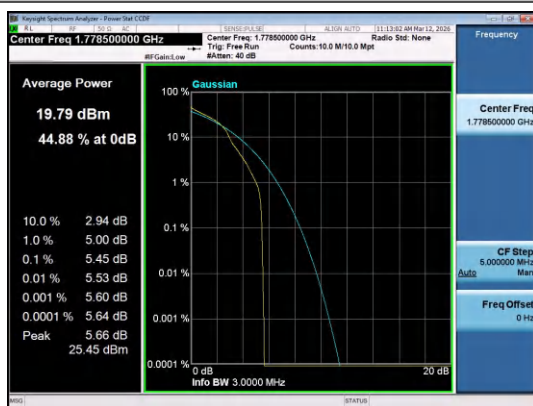


Band66-3MHz-16QAM-132657-1RB#0-PASS




Band66-3MHz-16QAM-132657-15RB#0-PASS

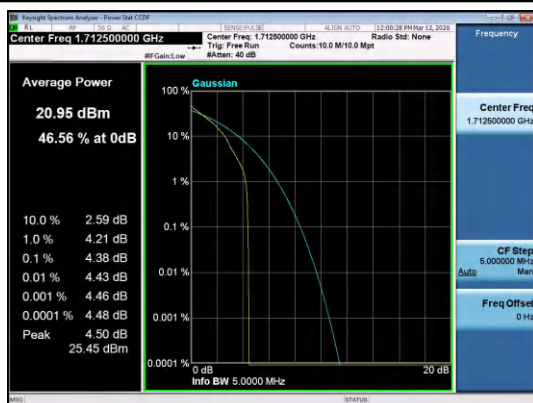


Band66-5MHz-QPSK-131997-1RB#0-PASS

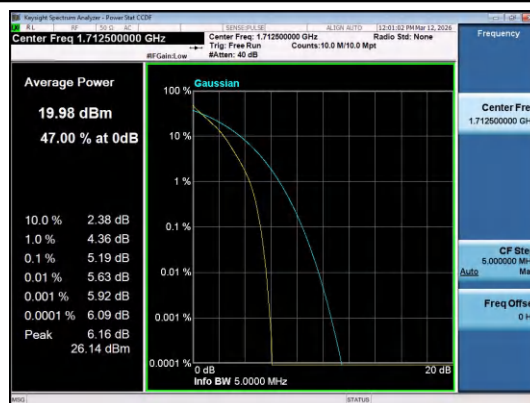


Band66-5MHz-QPSK-131997-25RB#0-PASS

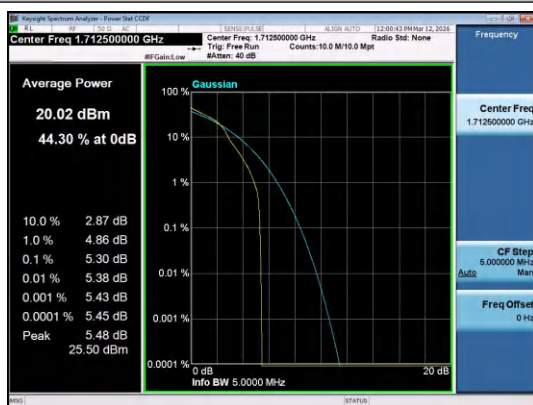


Band66-5MHz-16QAM-131997-1RB#0-PASS

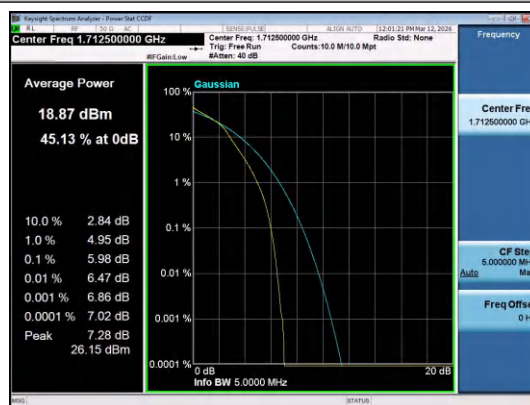


Band66-5MHz-16QAM-131997-25RB#0-PASS

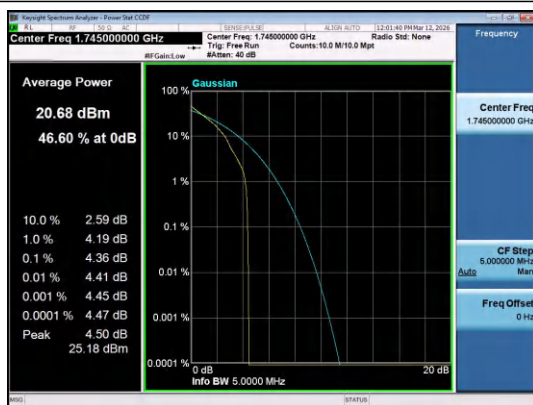


Band66-5MHz-QPSK-132322-1RB#0-PASS

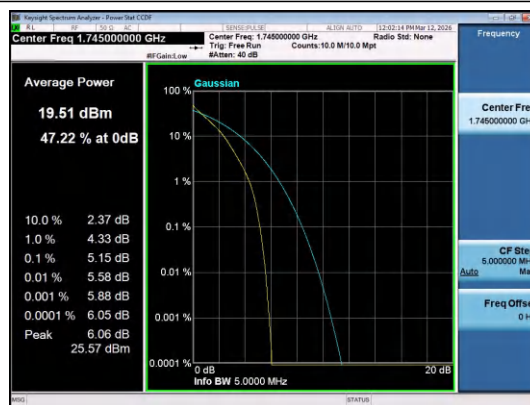


Band66-5MHz-QPSK-132322-25RB#0-PASS

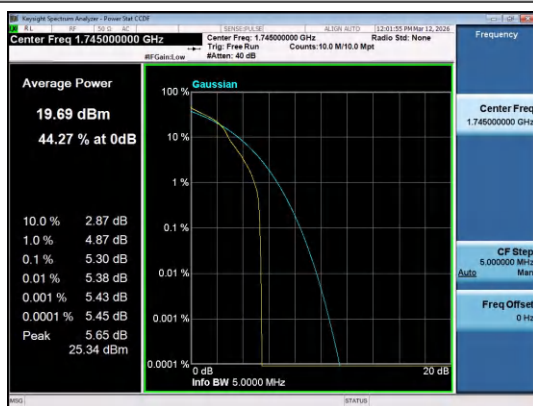


Band66-5MHz-16QAM-132322-1RB#0-PASS

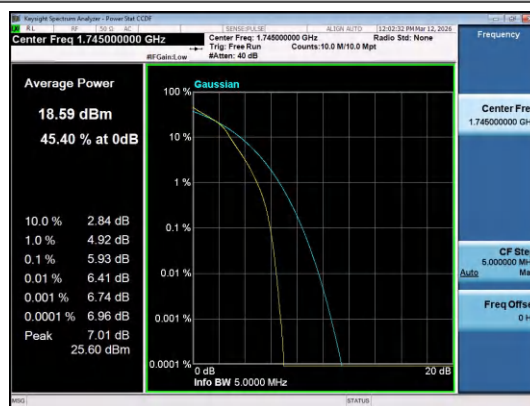


Band66-5MHz-16QAM-132322-25RB#0-PASS

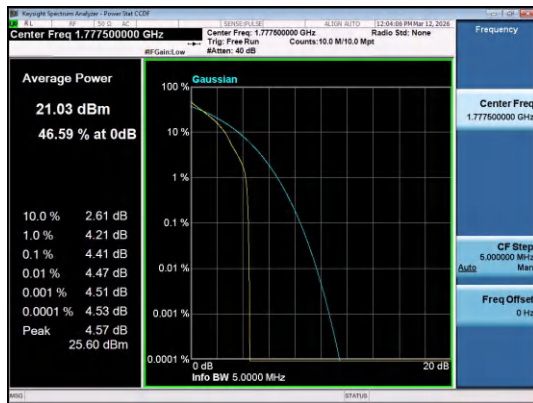


Band66-5MHz-QPSK-132647-1RB#0-PASS

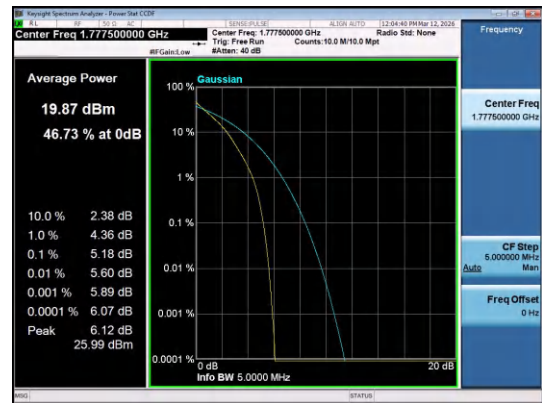


Band66-5MHz-QPSK-132647-25RB#0-PASS

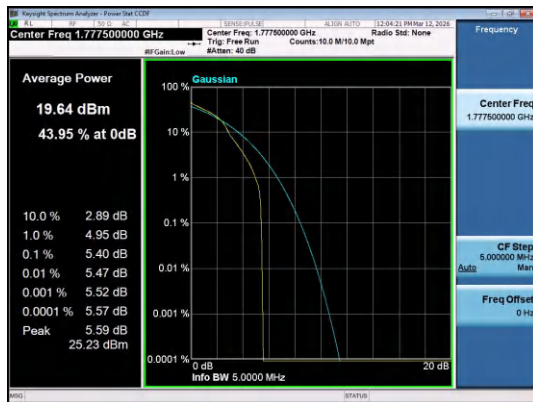


Band66-5MHz-16QAM-132647-1RB#0-PASS

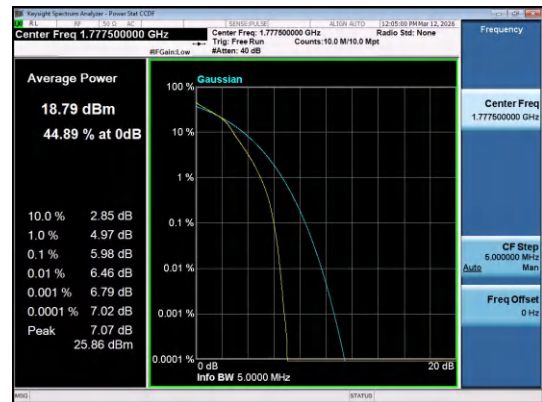


Band66-5MHz-16QAM-132647-25RB#0-PASS

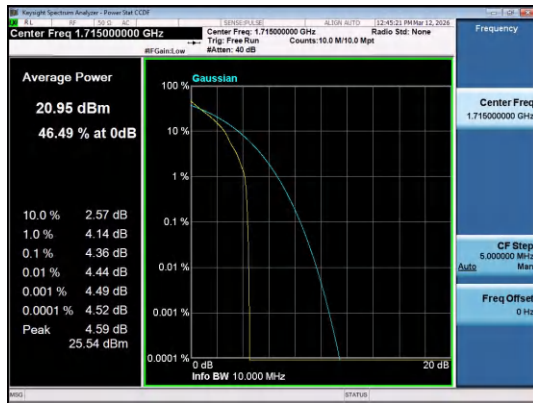


Band66-10MHz-QPSK-132022-1RB#0-PASS

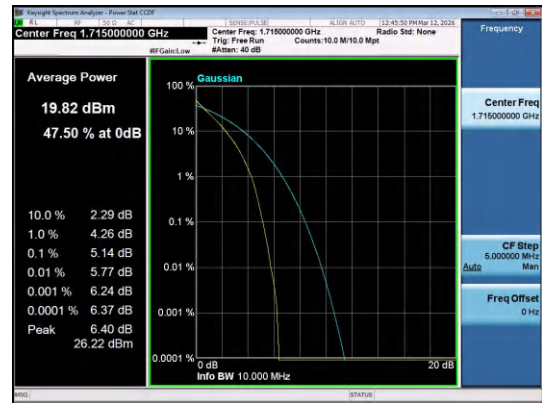


Band66-10MHz-QPSK-132022-50RB#0-PASS

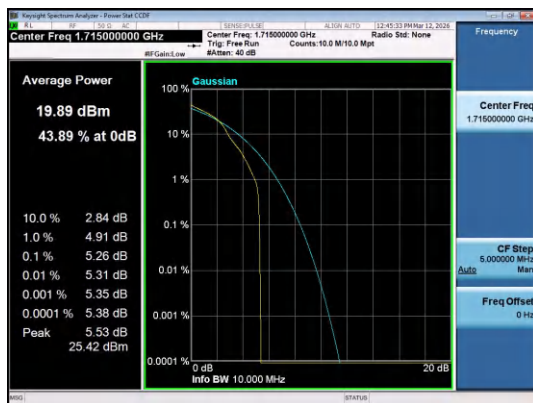


Band66-10MHz-16QAM-132022-1RB#0-PASS

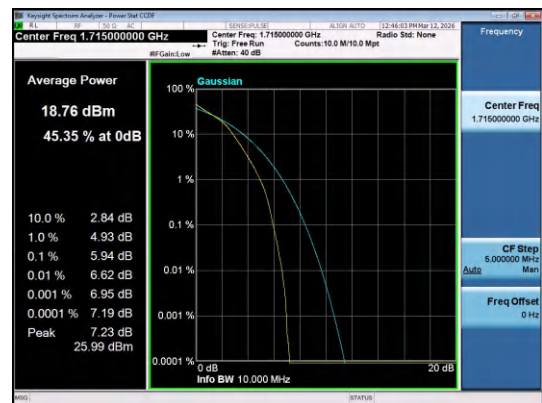


Band66-10MHz-16QAM-132022-50RB#0-PASS

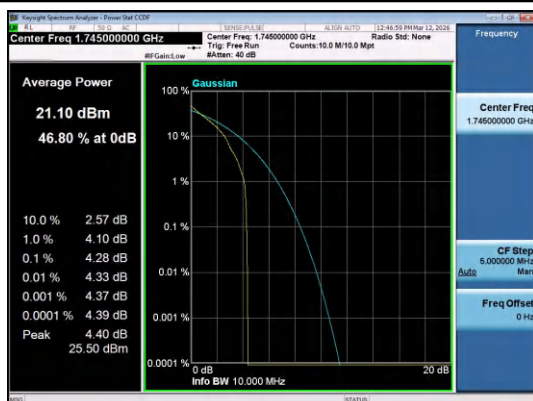


Band66-10MHz-QPSK-132322-1RB#0-PASS

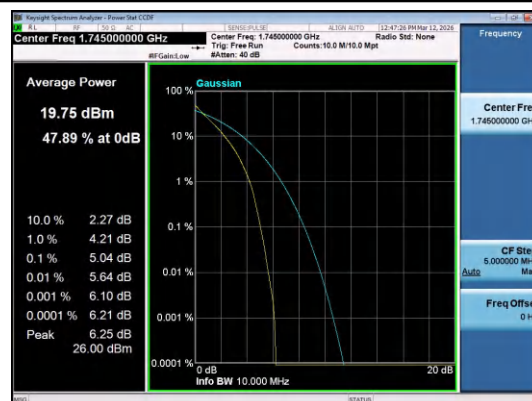


Band66-10MHz-QPSK-132322-50RB#0-PASS

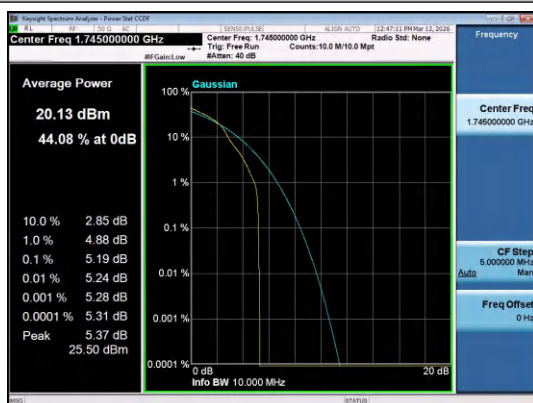


Band66-10MHz-16QAM-132322-1RB#0-PASS

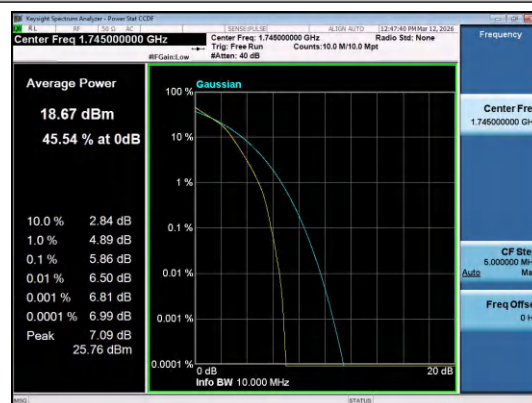


Band66-10MHz-16QAM-132322-50RB#0-PASS

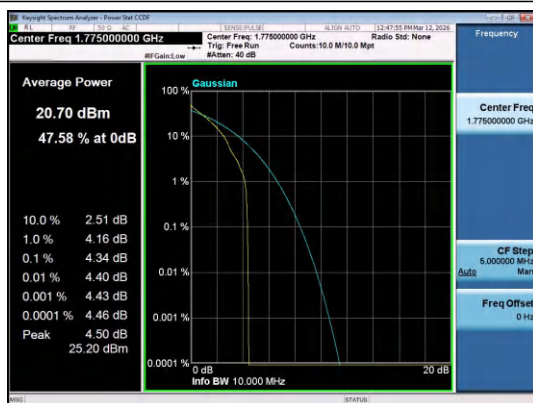


Band66-10MHz-QPSK-132622-1RB#0-PASS

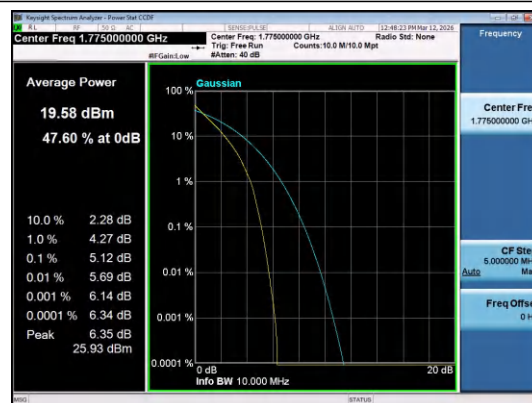


Band66-10MHz-QPSK-132622-50RB#0-PASS

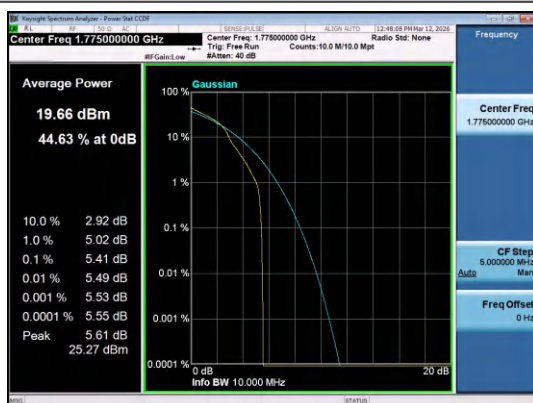

Band66-10MHz-16QAM-132622-1RB#0-PASS

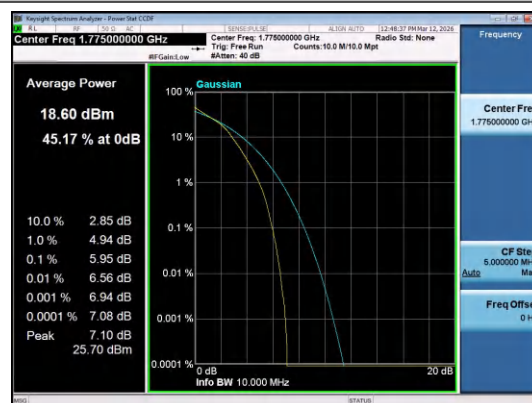


Band66-10MHz-16QAM-132622-50RB#0-PASS

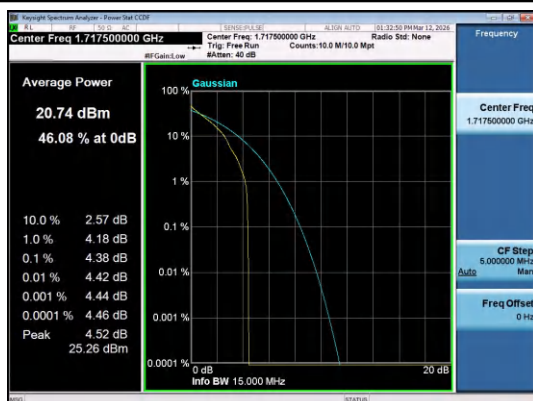

Band66-15MHz-QPSK-132047-1RB#0-PASS




Band66-15MHz-QPSK-132047-75RB#0-PASS

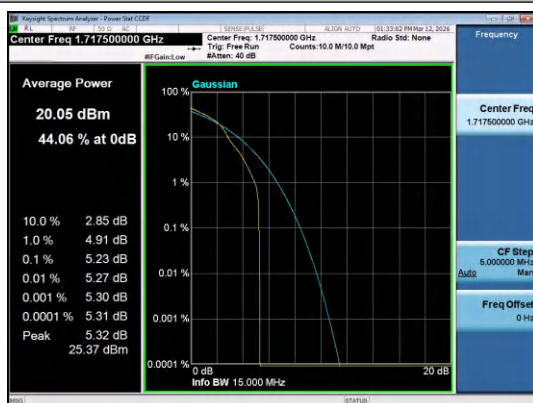


Band66-15MHz-16QAM-132047-1RB#0-PASS




Band66-15MHz-16QAM-132047-75RB#0-PASS

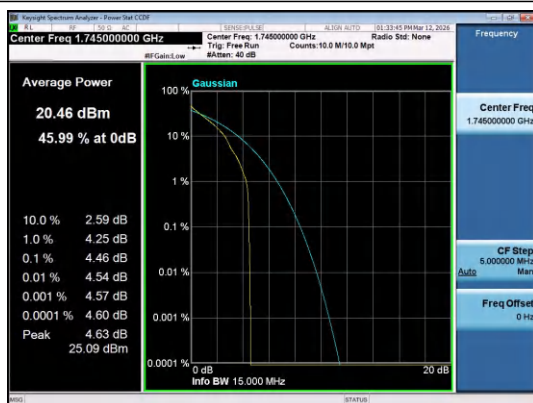

Band66-15MHz-QPSK-132322-1RB#0-PASS

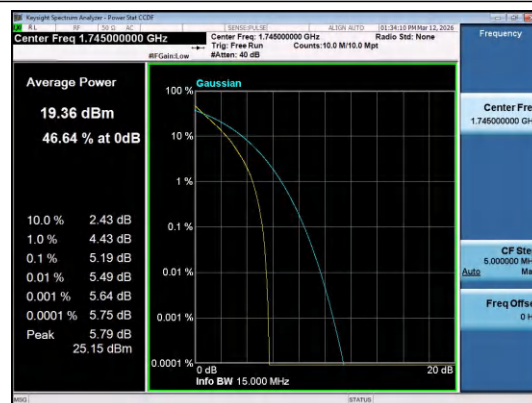









Band66-15MHz-QPSK-132322-75RB#0-PASS

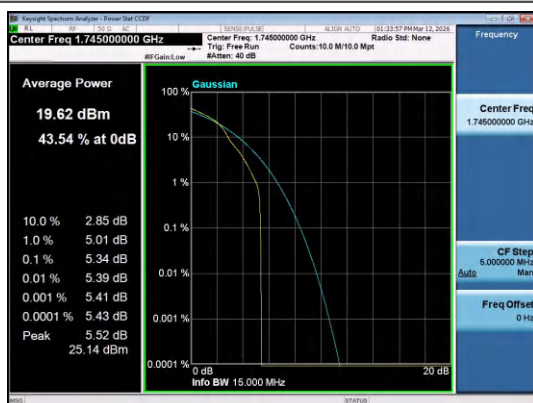


Band66-15MHz-16QAM-132322-1RB#0-PASS




Band66-15MHz-16QAM-132322-75RB#0-PASS

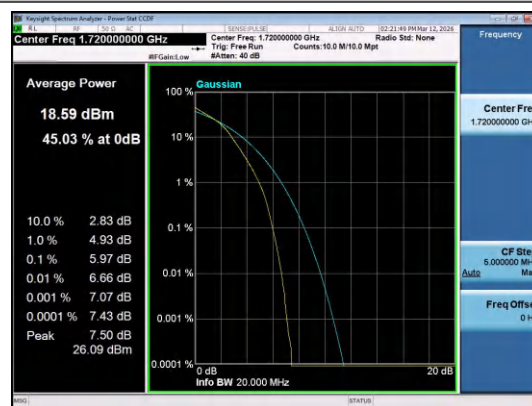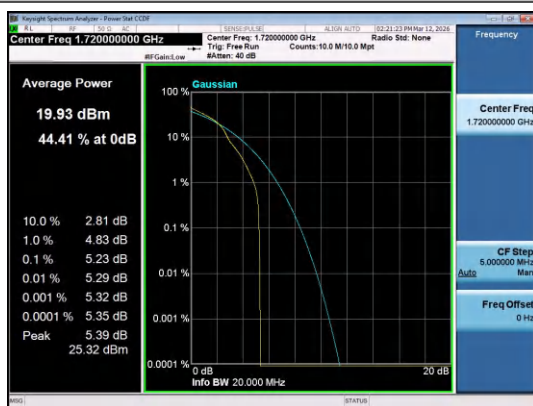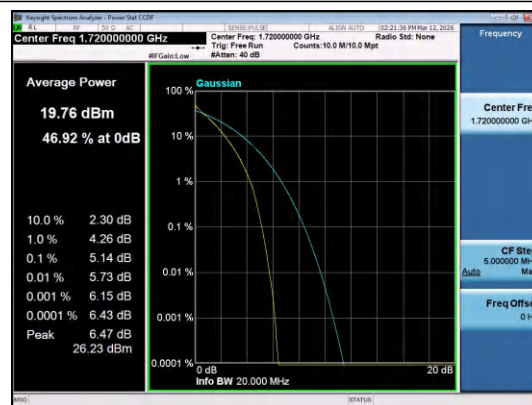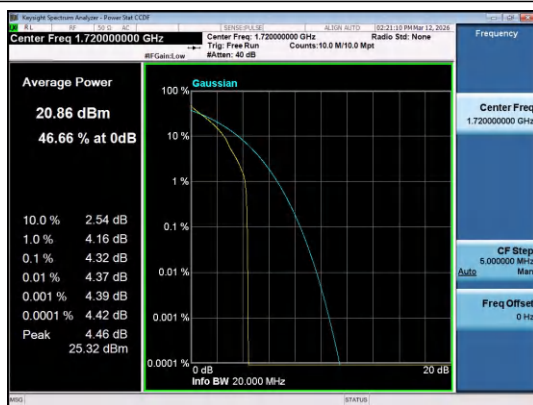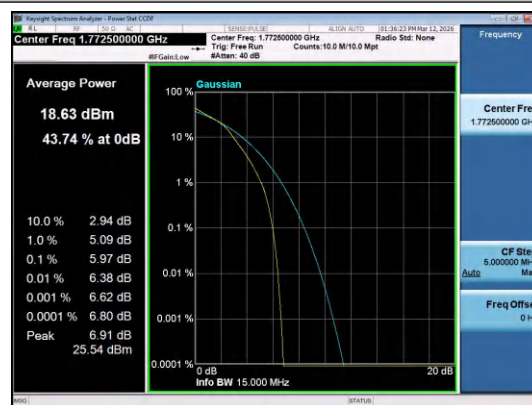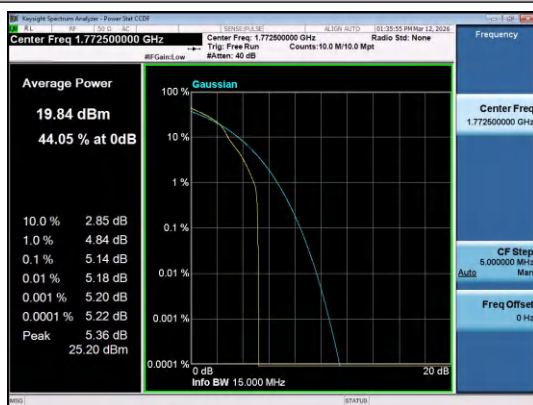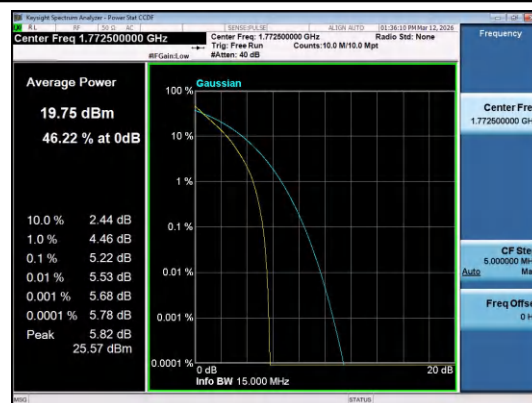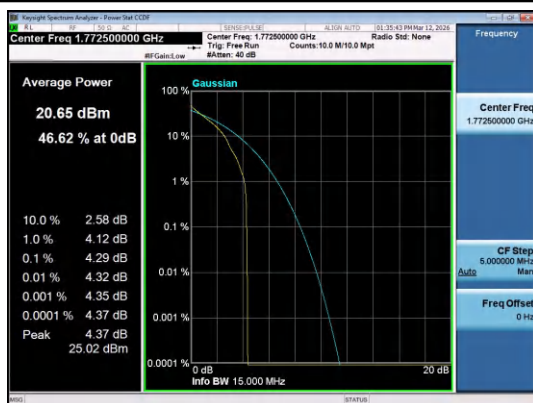


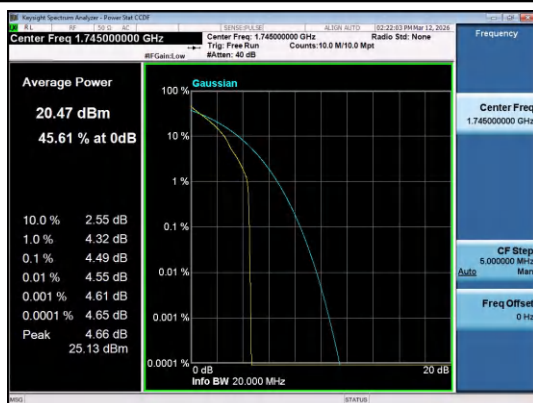


Band66-20MHz-QPSK-132322-1RB#0-PASS

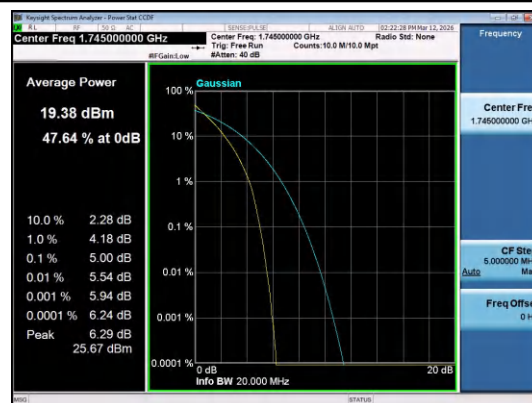


Band66-20MHz-QPSK-132322-100RB#0-PASS

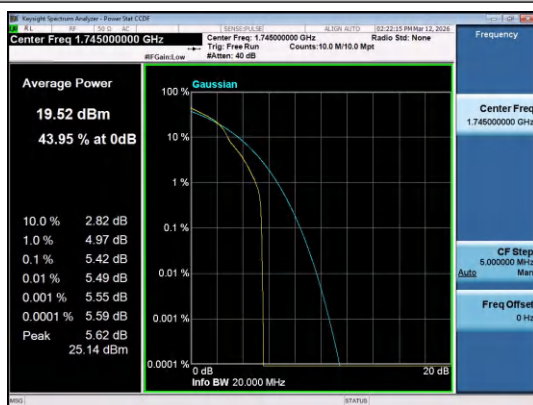


Band66-20MHz-16QAM-132322-1RB#0-PASS

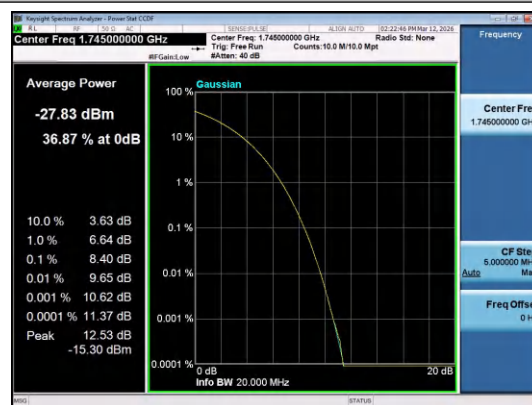


Band66-20MHz-16QAM-132322-100RB#0-PASS

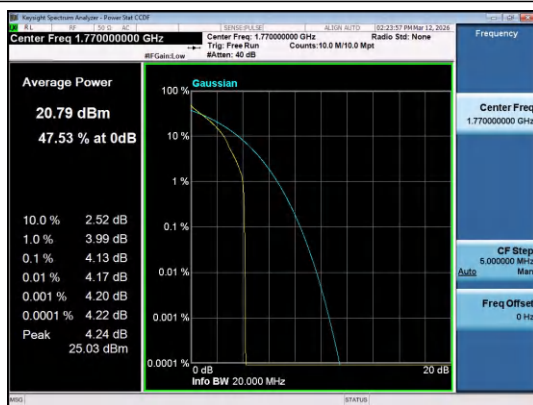


Band66-20MHz-QPSK-132572-1RB#0-PASS

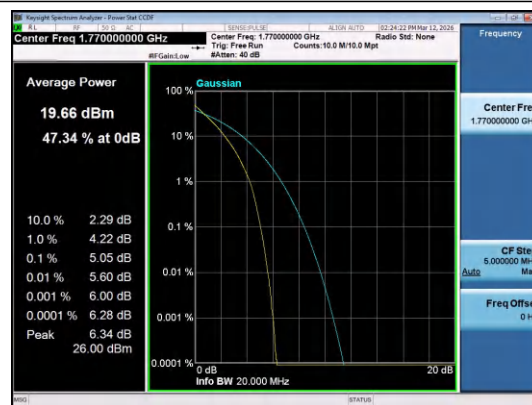

Band66-20MHz-QPSK-132572-100RB#0-PASS

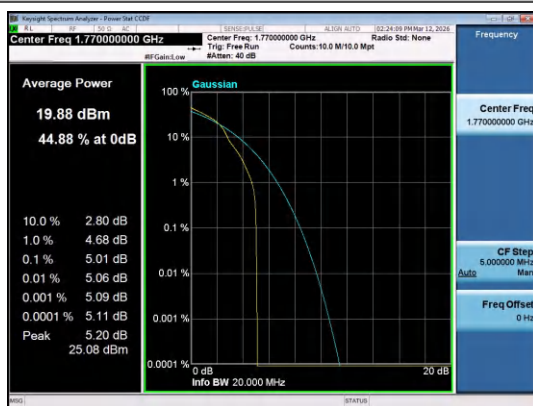

Band66-20MHz-16QAM-132572-1RB#0-PASS

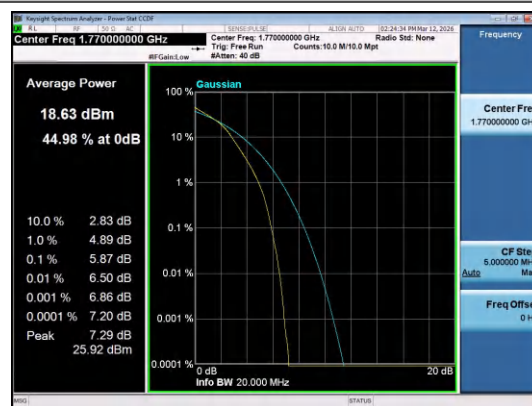

Band66-20MHz-16QAM-132572-100RB#0-PASS

Appendix C: 26dB Bandwidth and Occupied Bandwidth

Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band66	1.4MHz	QPSK	131979	6RB#0	1.0910	1.303	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	1.1009	1.287	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	1.0970	1.286	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	1.1010	1.289	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	1.0970	1.307	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	1.0911	1.281	PASS
Band66	3MHz	QPSK	131987	15RB#0	2.7052	2.961	PASS
Band66	3MHz	16QAM	131987	15RB#0	2.6873	2.955	PASS
Band66	3MHz	QPSK	132322	15RB#0	2.6986	2.968	PASS
Band66	3MHz	16QAM	132322	15RB#0	2.6964	2.984	PASS
Band66	3MHz	QPSK	132657	15RB#0	2.6956	2.958	PASS
Band66	3MHz	16QAM	132657	15RB#0	2.6892	2.970	PASS
Band66	5MHz	QPSK	131997	25RB#0	4.5049	4.992	PASS
Band66	5MHz	16QAM	131997	25RB#0	4.5050	5.005	PASS
Band66	5MHz	QPSK	132322	25RB#0	4.5029	5.015	PASS
Band66	5MHz	16QAM	132322	25RB#0	4.5025	4.995	PASS
Band66	5MHz	QPSK	132647	25RB#0	4.5010	4.978	PASS
Band66	5MHz	16QAM	132647	25RB#0	4.5063	5.014	PASS
Band66	10MHz	QPSK	132022	50RB#0	8.9668	9.848	PASS
Band66	10MHz	16QAM	132022	50RB#0	8.9716	9.815	PASS
Band66	10MHz	QPSK	132322	50RB#0	8.9709	9.907	PASS
Band66	10MHz	16QAM	132322	50RB#0	8.9459	9.833	PASS
Band66	10MHz	QPSK	132622	50RB#0	8.9823	9.836	PASS
Band66	10MHz	16QAM	132622	50RB#0	8.9718	9.864	PASS
Band66	15MHz	QPSK	132047	75RB#0	13.457	14.83	PASS
Band66	15MHz	16QAM	132047	75RB#0	13.466	14.74	PASS
Band66	15MHz	QPSK	132322	75RB#0	13.440	14.75	PASS
Band66	15MHz	16QAM	132322	75RB#0	13.455	14.70	PASS
Band66	15MHz	QPSK	132597	75RB#0	13.439	14.74	PASS
Band66	15MHz	16QAM	132597	75RB#0	13.465	14.66	PASS
Band66	20MHz	QPSK	132072	100RB#0	17.924	19.46	PASS
Band66	20MHz	16QAM	132072	100RB#0	17.917	19.47	PASS
Band66	20MHz	QPSK	132322	100RB#0	17.885	19.50	PASS
Band66	20MHz	16QAM	132322	100RB#0	17.891	19.43	PASS
Band66	20MHz	QPSK	132572	100RB#0	17.904	19.62	PASS
Band66	20MHz	16QAM	132572	100RB#0	17.871	19.39	PASS

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

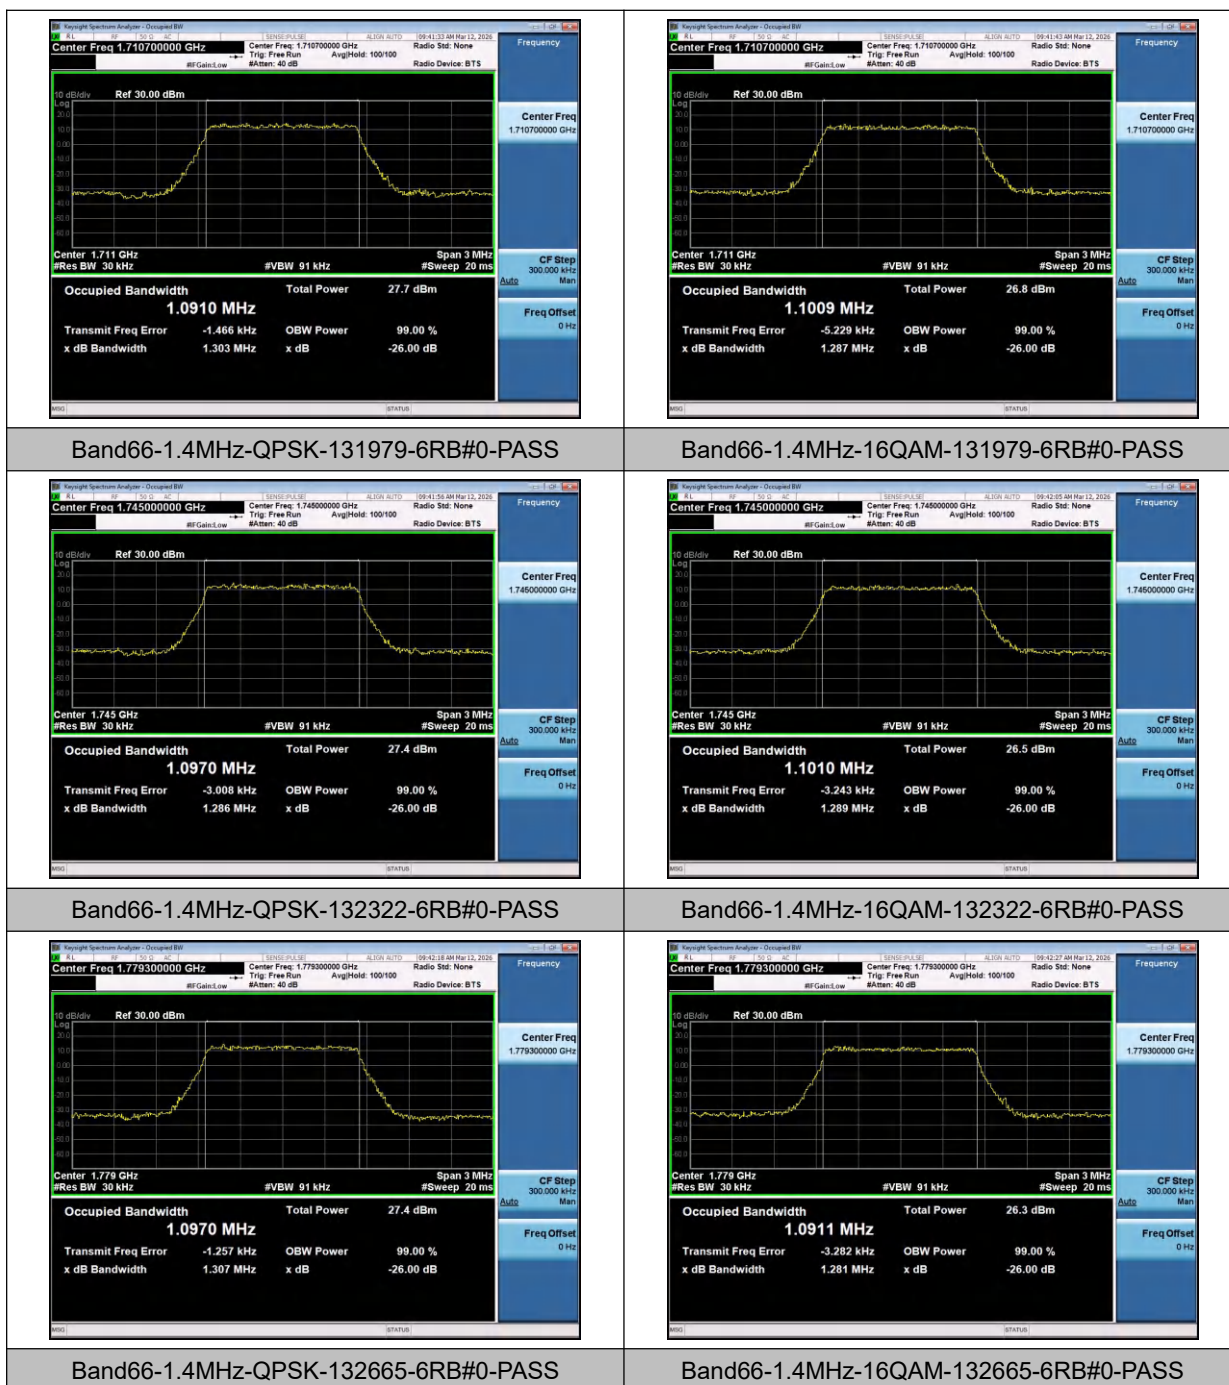




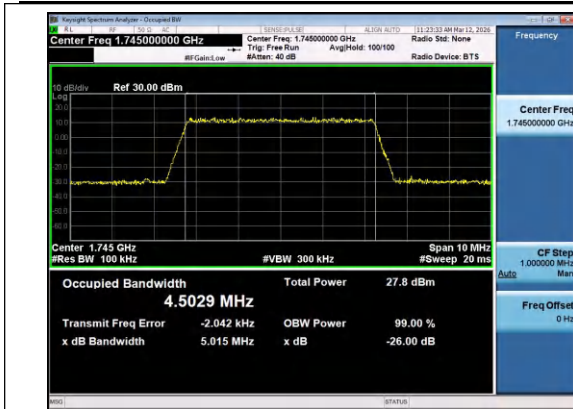


Band66-5MHz-QPSK-132322-25RB#0-PASS

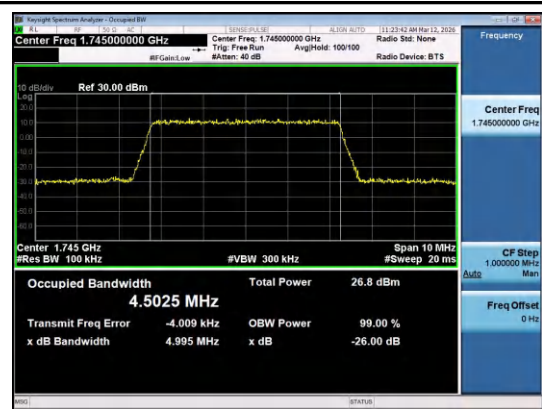


Band66-5MHz-16QAM-132322-25RB#0-PASS

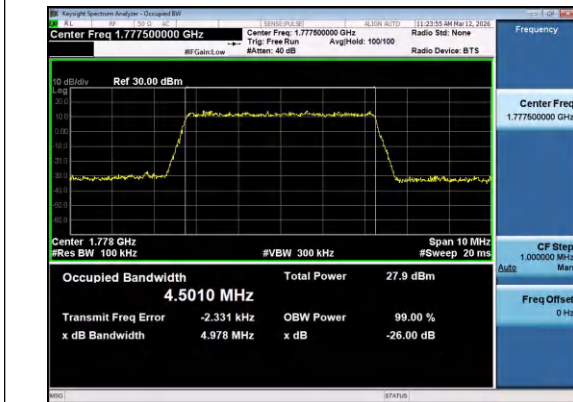


Band66-5MHz-QPSK-132647-25RB#0-PASS

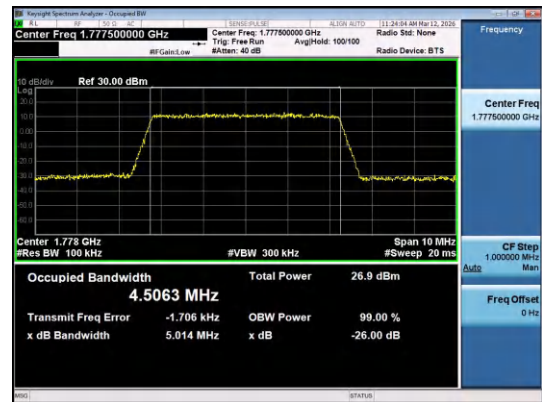


Band66-5MHz-16QAM-132647-25RB#0-PASS

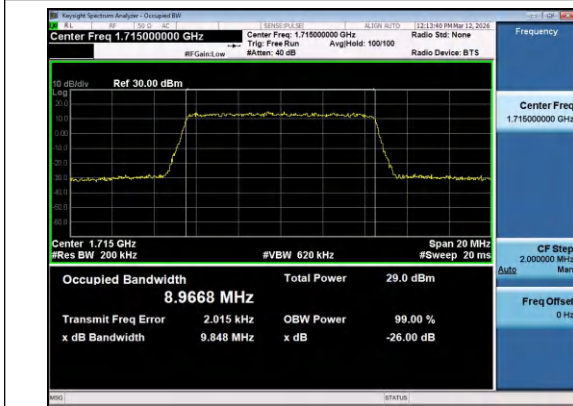


Band66-10MHz-QPSK-132022-50RB#0-PASS

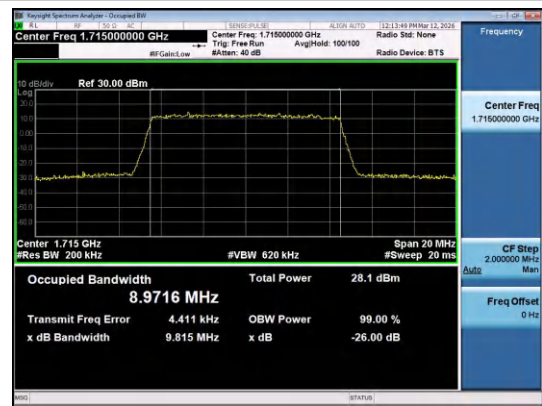

Band66-10MHz-16QAM-132022-50RB#0-PASS

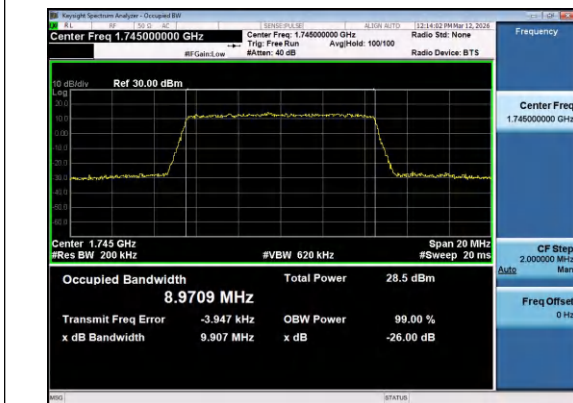


Band66-10MHz-QPSK-132322-50RB#0-PASS

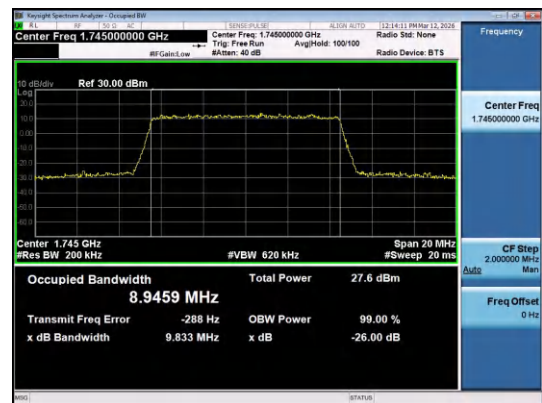

Band66-10MHz-16QAM-132322-50RB#0-PASS



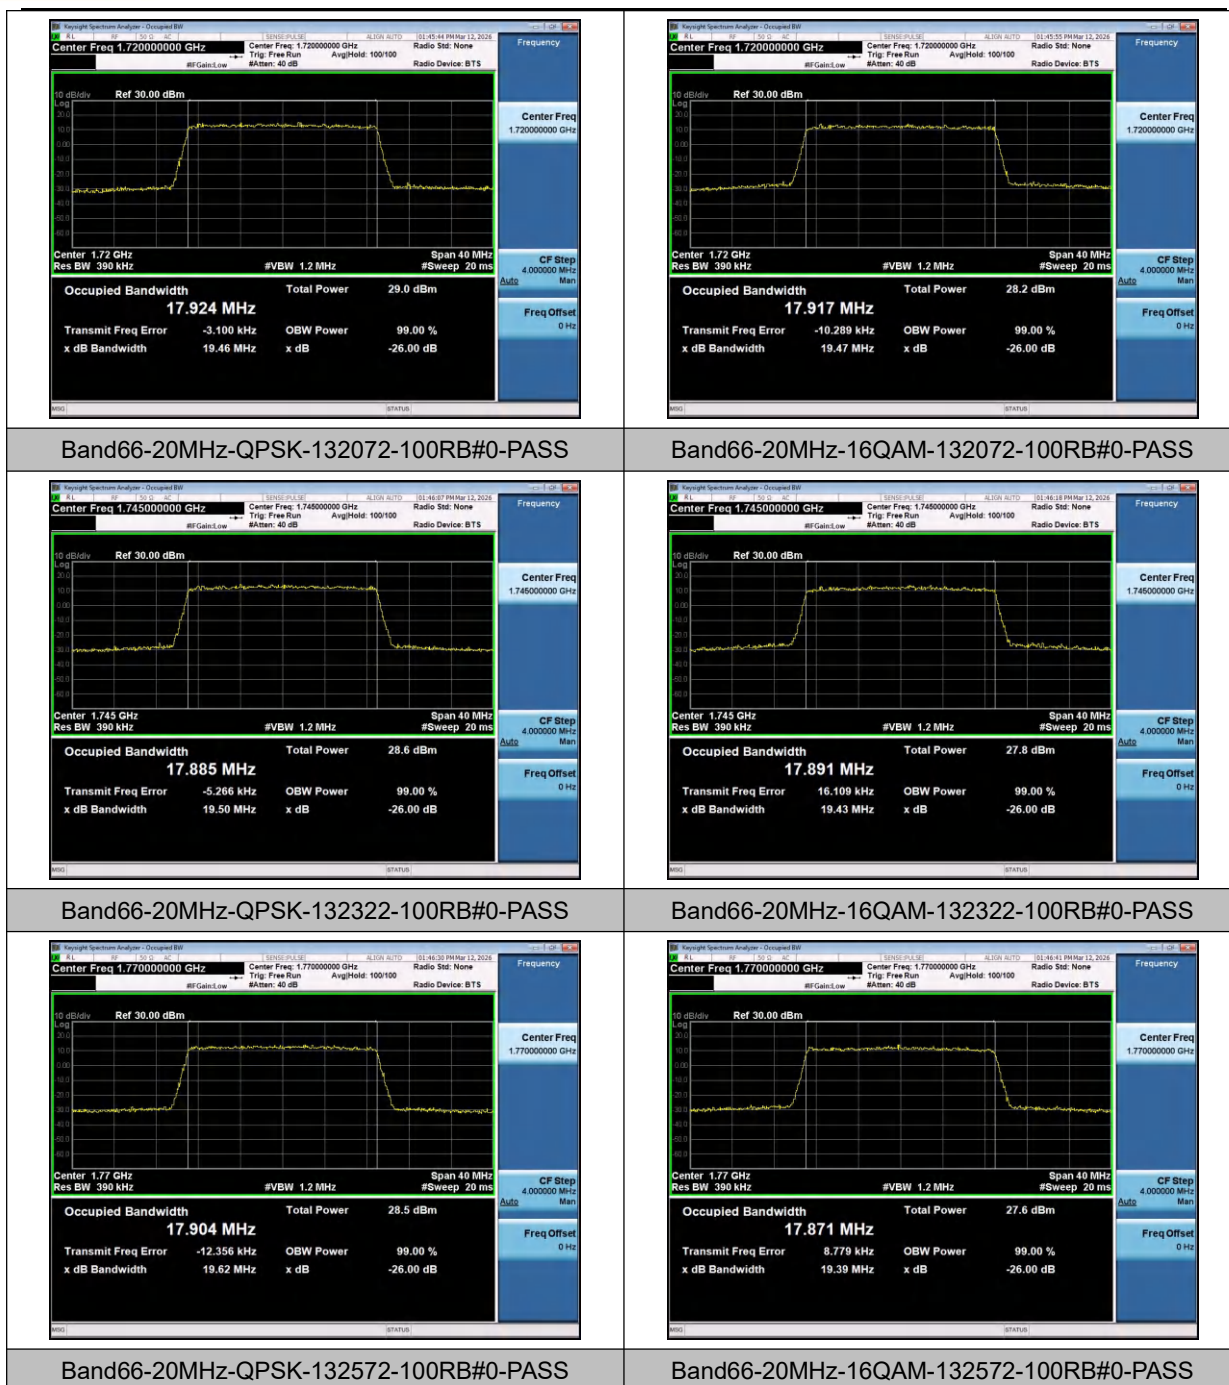

Appendix D: Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Margin (dB)	Verdict
Band66	1.4MHz	QPSK	131979	1RB#0	-28.19	15.19	PASS
Band66	1.4MHz	QPSK	131979	1RB#5	-38.38	25.38	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	-35.99	22.99	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	-31.03	18.03	PASS
Band66	1.4MHz	16QAM	131979	1RB#5	-38.96	25.96	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	-36.08	23.08	PASS
Band66	1.4MHz	QPSK	132665	1RB#0	-34.66	21.66	PASS
Band66	1.4MHz	QPSK	132665	1RB#5	-27.51	14.51	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	-29.36	16.36	PASS
Band66	1.4MHz	16QAM	132665	1RB#0	-34.74	21.74	PASS
Band66	1.4MHz	16QAM	132665	1RB#5	-32.00	19.00	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	-35.57	22.57	PASS
Band66	3MHz	QPSK	131987	1RB#0	-27.50	14.50	PASS
Band66	3MHz	QPSK	131987	1RB#14	-47.84	34.84	PASS
Band66	3MHz	QPSK	131987	15RB#0	-34.69	21.69	PASS
Band66	3MHz	16QAM	131987	1RB#0	-28.44	15.44	PASS
Band66	3MHz	16QAM	131987	1RB#14	-49.78	36.78	PASS
Band66	3MHz	16QAM	131987	15RB#0	-35.33	22.33	PASS
Band66	3MHz	QPSK	132657	1RB#0	-49.17	36.17	PASS
Band66	3MHz	QPSK	132657	1RB#14	-28.71	15.71	PASS
Band66	3MHz	QPSK	132657	15RB#0	-36.53	23.53	PASS
Band66	3MHz	16QAM	132657	1RB#0	-49.51	36.51	PASS
Band66	3MHz	16QAM	132657	1RB#14	-28.53	15.53	PASS
Band66	3MHz	16QAM	132657	15RB#0	-56.29	43.29	PASS
Band66	5MHz	QPSK	131997	1RB#0	-29.86	16.86	PASS
Band66	5MHz	QPSK	131997	1RB#24	-54.60	41.60	PASS
Band66	5MHz	QPSK	131997	25RB#0	-36.75	23.75	PASS
Band66	5MHz	16QAM	131997	1RB#0	-30.85	17.85	PASS
Band66	5MHz	16QAM	131997	1RB#24	-54.60	41.60	PASS
Band66	5MHz	16QAM	131997	25RB#0	-38.22	25.22	PASS
Band66	5MHz	QPSK	132647	1RB#0	-54.18	41.18	PASS
Band66	5MHz	QPSK	132647	1RB#24	-30.42	17.42	PASS
Band66	5MHz	QPSK	132647	25RB#0	-38.08	25.08	PASS
Band66	5MHz	16QAM	132647	1RB#0	-54.51	41.51	PASS
Band66	5MHz	16QAM	132647	1RB#24	-31.73	18.73	PASS
Band66	5MHz	16QAM	132647	25RB#0	-38.67	25.67	PASS
Band66	10MHz	QPSK	132022	1RB#0	-40.34	27.34	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Band66	10MHz	QPSK	132022	1RB#49	-51.68	38.68	PASS
Band66	10MHz	QPSK	132022	50RB#0	-38.58	25.58	PASS
Band66	10MHz	16QAM	132022	1RB#0	-41.65	28.65	PASS
Band66	10MHz	16QAM	132022	1RB#49	-52.40	39.40	PASS
Band66	10MHz	16QAM	132022	50RB#0	-39.83	26.83	PASS
Band66	10MHz	QPSK	132622	1RB#0	-51.91	38.91	PASS
Band66	10MHz	QPSK	132622	1RB#49	-40.95	27.95	PASS
Band66	10MHz	QPSK	132622	50RB#0	-40.45	27.45	PASS
Band66	10MHz	16QAM	132622	1RB#0	-51.81	38.81	PASS
Band66	10MHz	16QAM	132622	1RB#49	-42.55	29.55	PASS
Band66	10MHz	16QAM	132622	50RB#0	-41.16	28.16	PASS
Band66	15MHz	QPSK	132047	1RB#0	-41.70	28.70	PASS
Band66	15MHz	QPSK	132047	1RB#74	-50.66	37.66	PASS
Band66	15MHz	QPSK	132047	75RB#0	-40.62	27.62	PASS
Band66	15MHz	16QAM	132047	1RB#0	-42.65	29.65	PASS
Band66	15MHz	16QAM	132047	1RB#74	-51.11	38.11	PASS
Band66	15MHz	16QAM	132047	75RB#0	-40.24	27.24	PASS
Band66	15MHz	QPSK	132597	1RB#0	-50.36	37.36	PASS
Band66	15MHz	QPSK	132597	1RB#74	-41.99	28.99	PASS
Band66	15MHz	QPSK	132597	75RB#0	-41.13	28.13	PASS
Band66	15MHz	16QAM	132597	1RB#0	-50.44	37.44	PASS
Band66	15MHz	16QAM	132597	1RB#74	-42.53	29.53	PASS
Band66	15MHz	16QAM	132597	75RB#0	-42.24	29.24	PASS
Band66	20MHz	QPSK	132072	1RB#0	-43.15	30.15	PASS
Band66	20MHz	QPSK	132072	1RB#99	-49.82	36.82	PASS
Band66	20MHz	QPSK	132072	100RB#0	-41.90	28.90	PASS
Band66	20MHz	16QAM	132072	1RB#0	-43.76	30.76	PASS
Band66	20MHz	16QAM	132072	1RB#99	-49.92	36.92	PASS
Band66	20MHz	16QAM	132072	100RB#0	-41.22	28.22	PASS
Band66	20MHz	QPSK	132572	1RB#0	-49.28	36.28	PASS
Band66	20MHz	QPSK	132572	1RB#99	-42.29	29.29	PASS
Band66	20MHz	QPSK	132572	100RB#0	-41.05	28.05	PASS
Band66	20MHz	16QAM	132572	1RB#0	-49.28	36.28	PASS
Band66	20MHz	16QAM	132572	1RB#99	-43.03	30.03	PASS
Band66	20MHz	16QAM	132572	100RB#0	-41.11	28.11	PASS


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

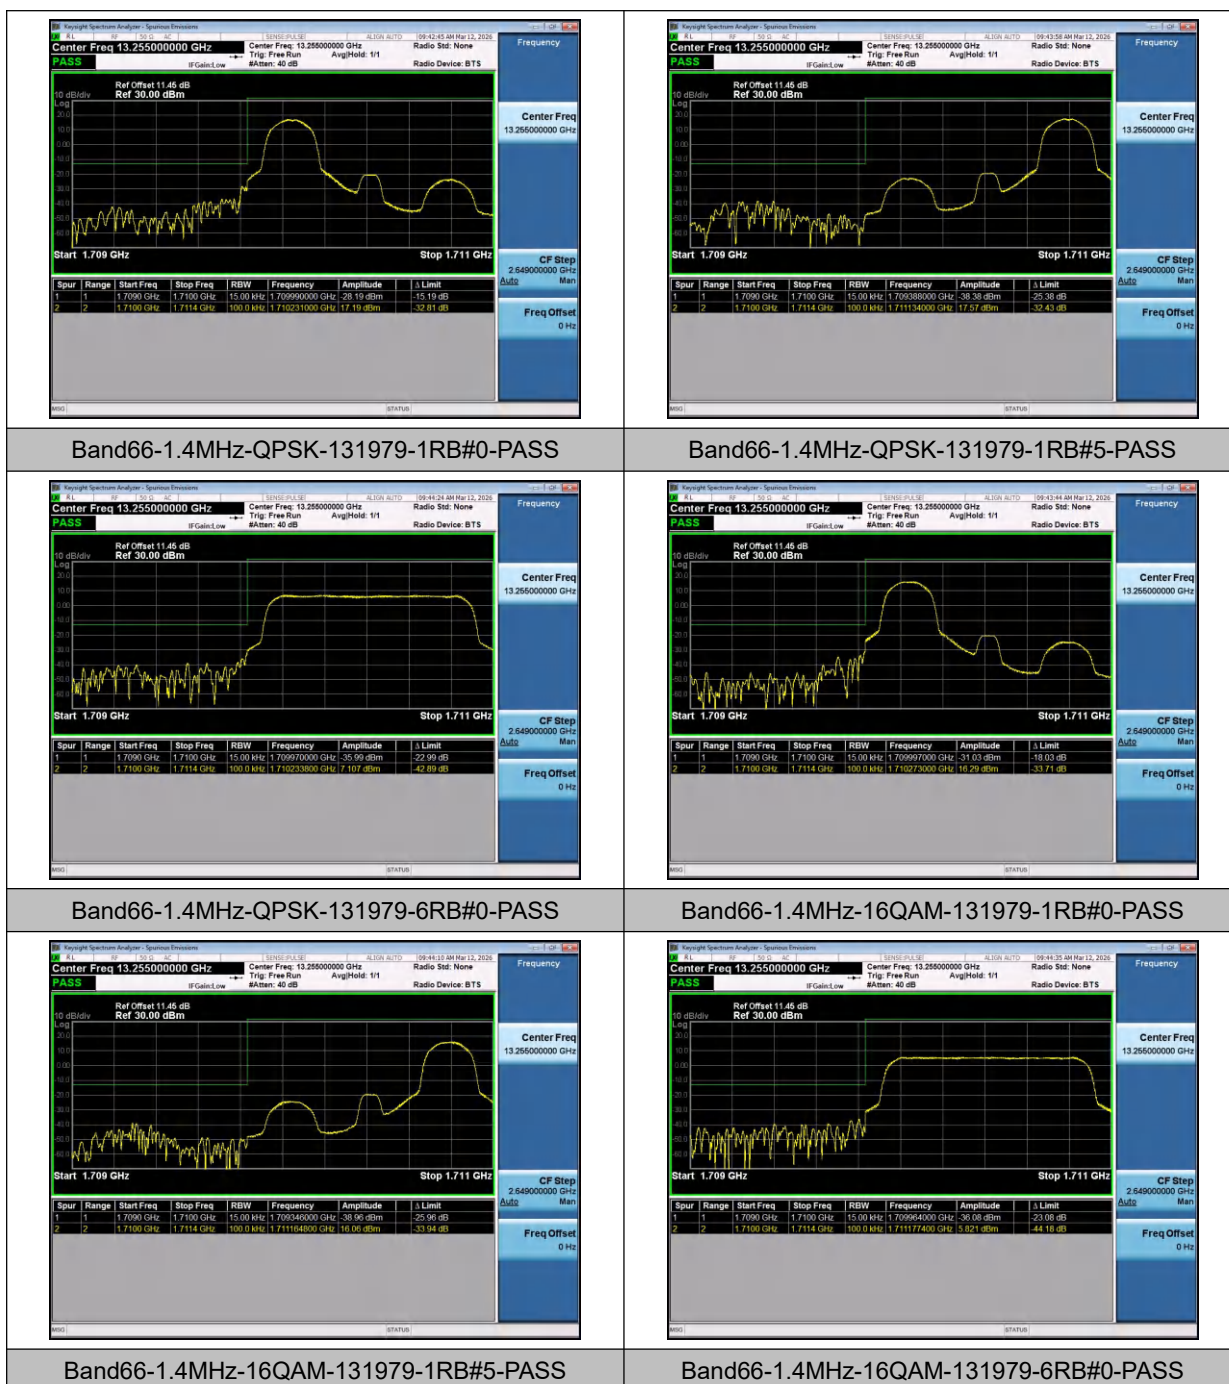

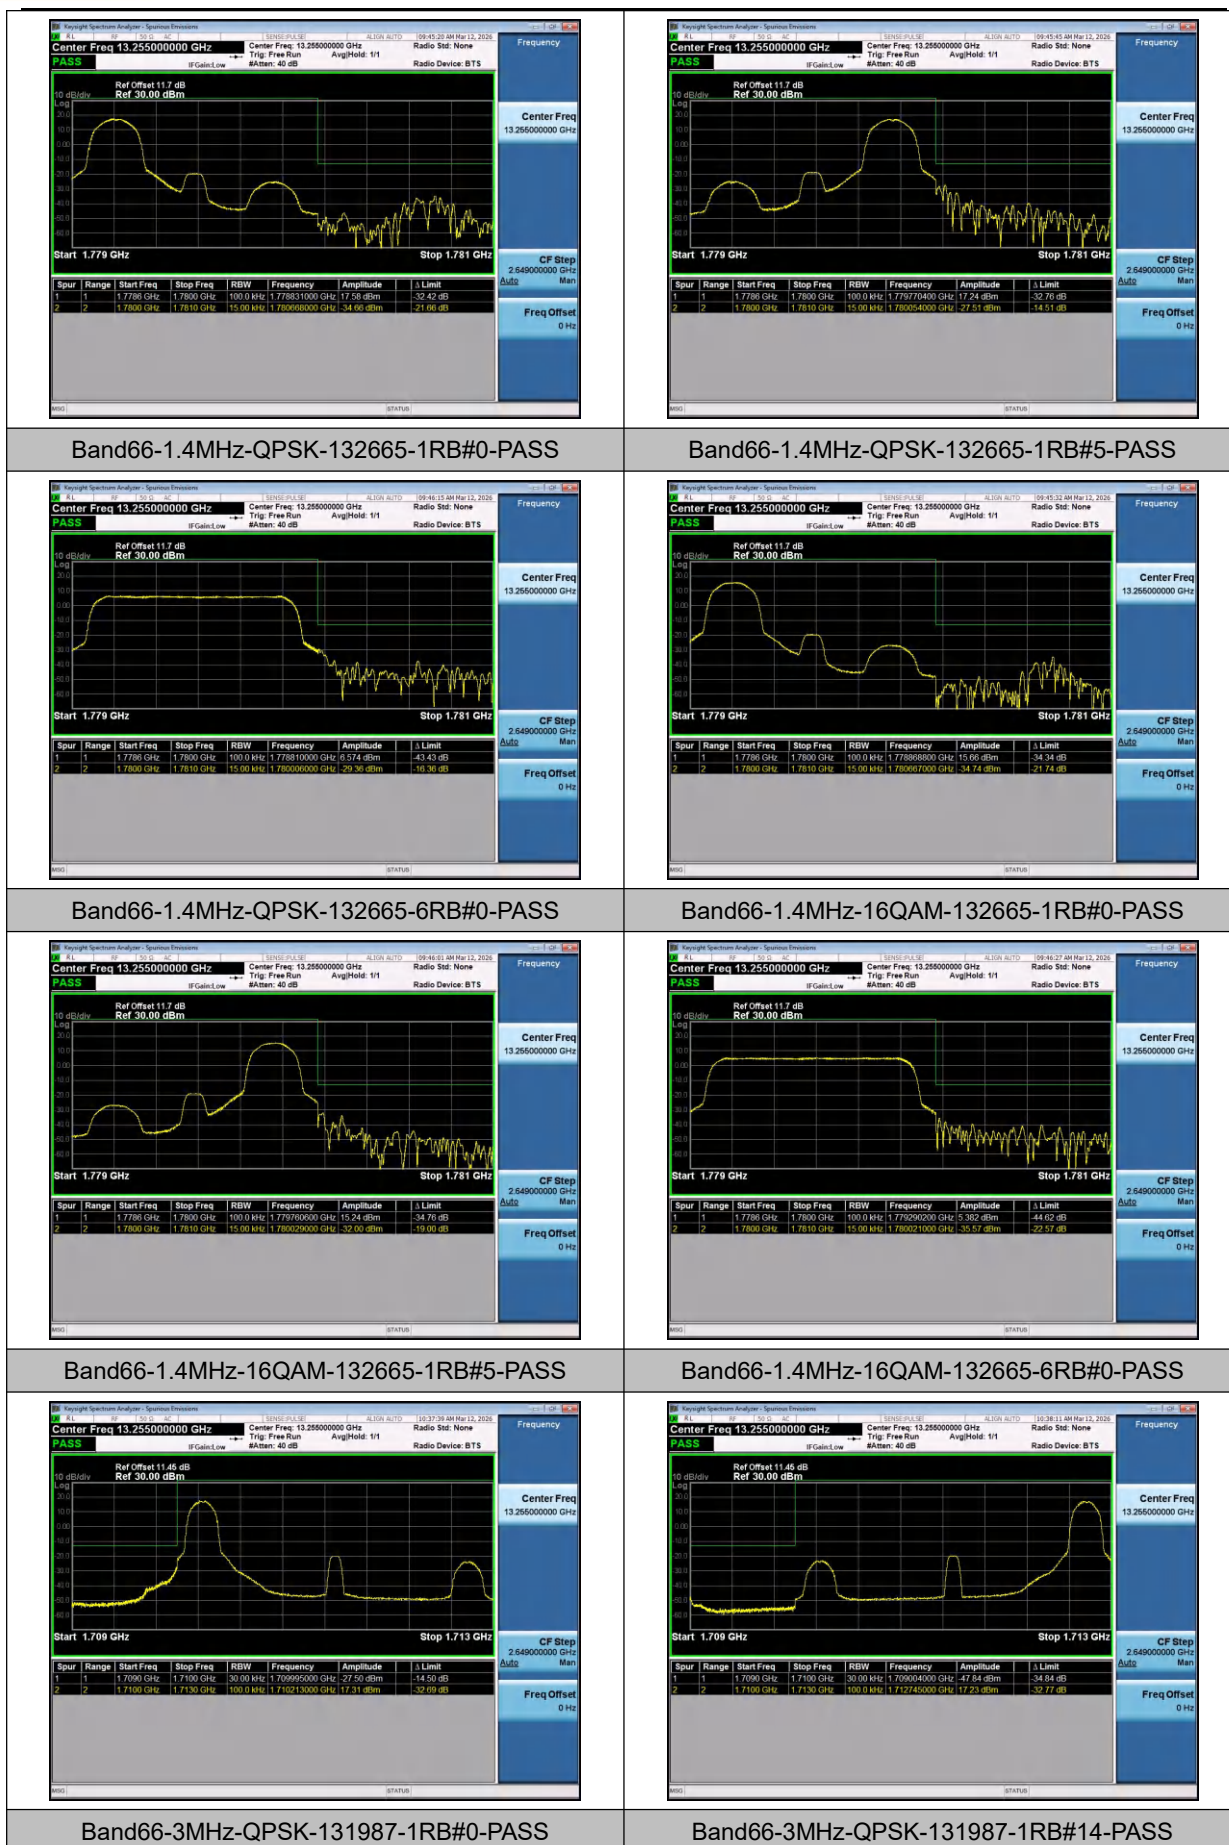


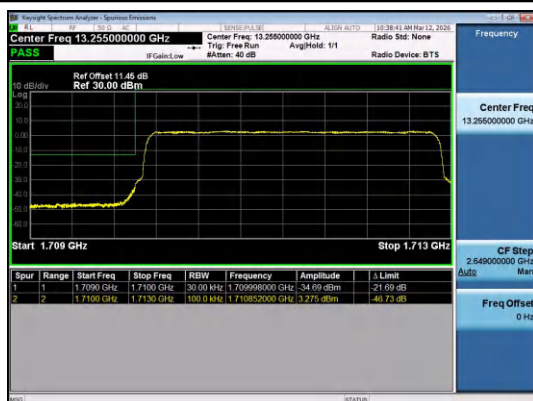


Band66-3MHz-QPSK-131987-15RB#0-PASS

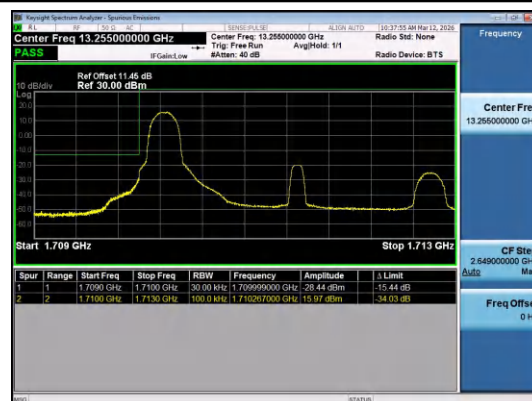


Band66-3MHz-16QAM-131987-1RB#0-PASS

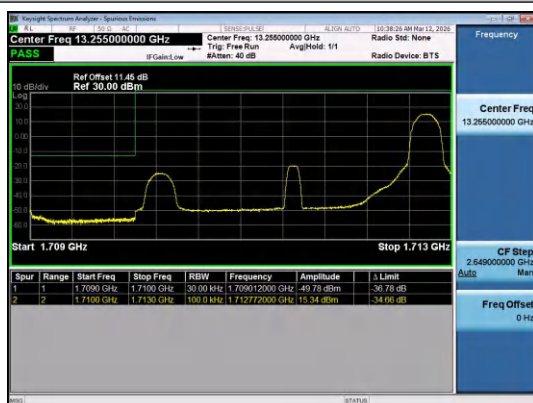


Band66-3MHz-16QAM-131987-1RB#14-PASS

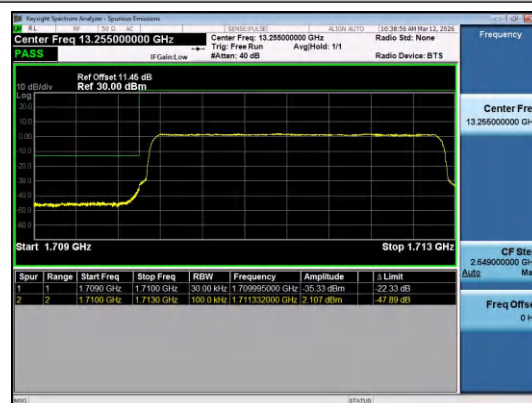


Band66-3MHz-16QAM-131987-15RB#0-PASS

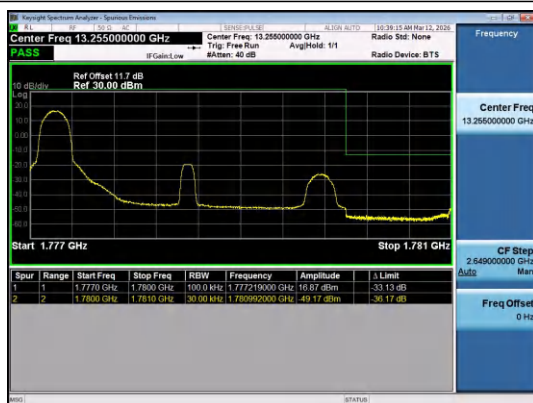


Band66-3MHz-QPSK-132657-1RB#0-PASS

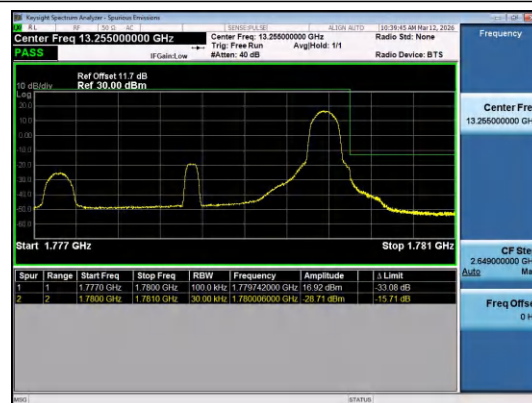

Band66-3MHz-QPSK-132657-1RB#14-PASS

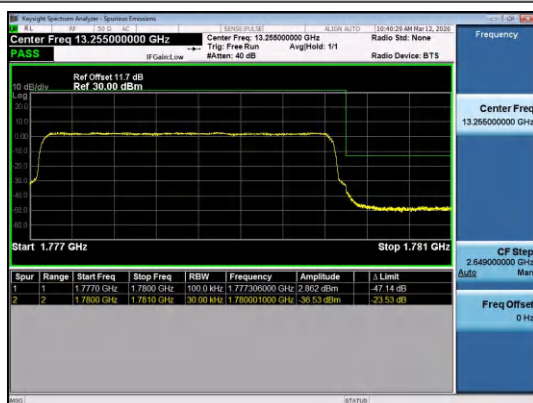

Band66-3MHz-QPSK-132657-15RB#0-PASS

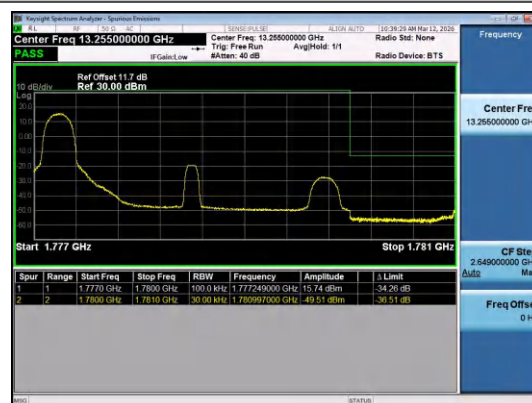

Band66-3MHz-16QAM-132657-1RB#0-PASS

