




8DPSK_3DH3_HOPP_Ant1_NTNV

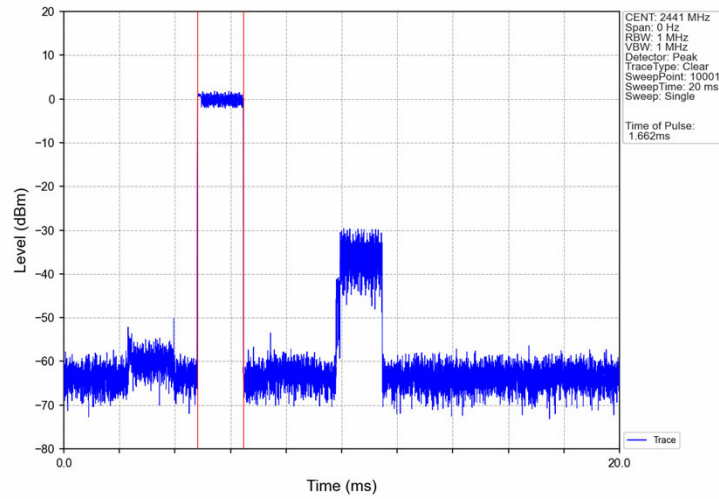


8DPSK_3DH3_HOPP_Ant1_NTNV

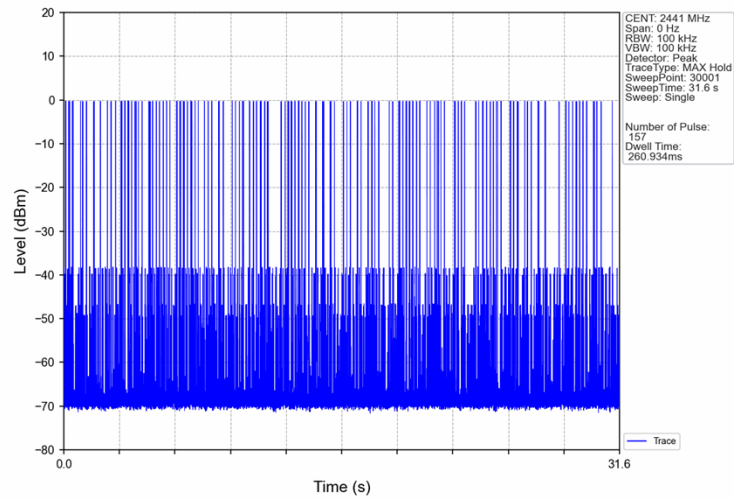

8DPSK_3DH5_HOPP_Ant1_NTNV

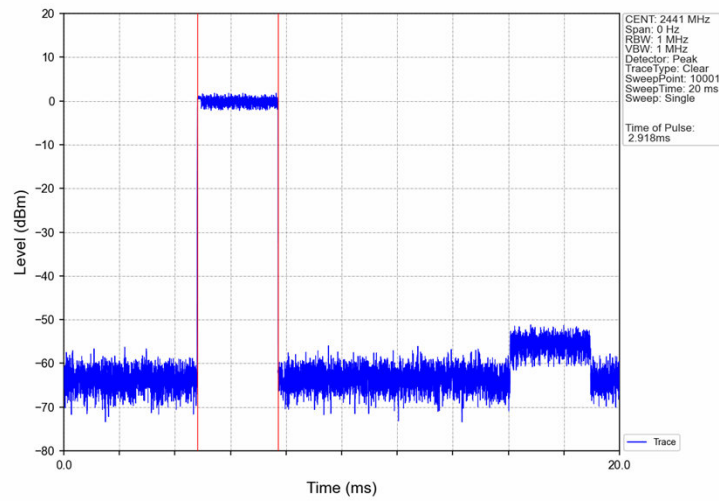

8DPSK_3DH5_HOPP_Ant1_NTNV

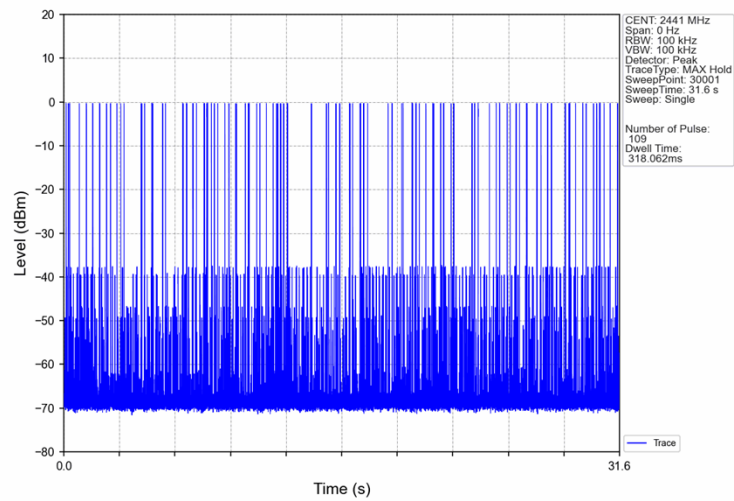

6. Unwanted Emissions In Non-restricted Frequency Bands

6.1 Test Result

6.1.1 Ref


Mode	TX Type	Frequency (MHz)	Packet Type	ANT	Level of Reference (dBm)
GFSK	SISO	2402	DH5	1	2.24
		2441	DH5	1	0.83
		2480	DH5	1	-0.37
		HOPP	DH5	1	2.06
					2.06
Pi/4DQPSK	SISO	2402	2DH5	1	2.11
		2441	2DH5	1	0.69
		2480	2DH5	1	-0.57
		HOPP	2DH5	1	1.51
					1.51
8DPSK	SISO	2402	3DH5	1	2.29
		2441	3DH5	1	0.89
		2480	3DH5	1	-0.31
		HOPP	3DH5	1	1.40
					1.40

6.1.2 CSE


Mode	TX Type	Frequency (MHz)	Packet Type	ANT	Level of Reference (dBm)	Limit (dBm)	Verdict
GFSK	SISO	2402	DH5	1	2.24	-17.76	Pass
		2441	DH5	1	0.83	-19.17	Pass
		2480	DH5	1	-0.37	-20.37	Pass
		HOPP	DH5	1	2.06	-17.94	Pass
					2.06	-17.94	Pass
Pi/4DQPSK	SISO	2402	2DH5	1	2.11	-17.89	Pass
		2441	2DH5	1	0.69	-19.31	Pass
		2480	2DH5	1	-0.57	-20.57	Pass
		HOPP	2DH5	1	1.51	-18.49	Pass
					1.51	-18.49	Pass
8DPSK	SISO	2402	3DH5	1	2.29	-17.71	Pass
		2441	3DH5	1	0.89	-19.11	Pass
		2480	3DH5	1	-0.31	-20.31	Pass
		HOPP	3DH5	1	1.40	-18.60	Pass
					1.40	-18.60	Pass

6.2 Test Graph


6.2.1 Ref

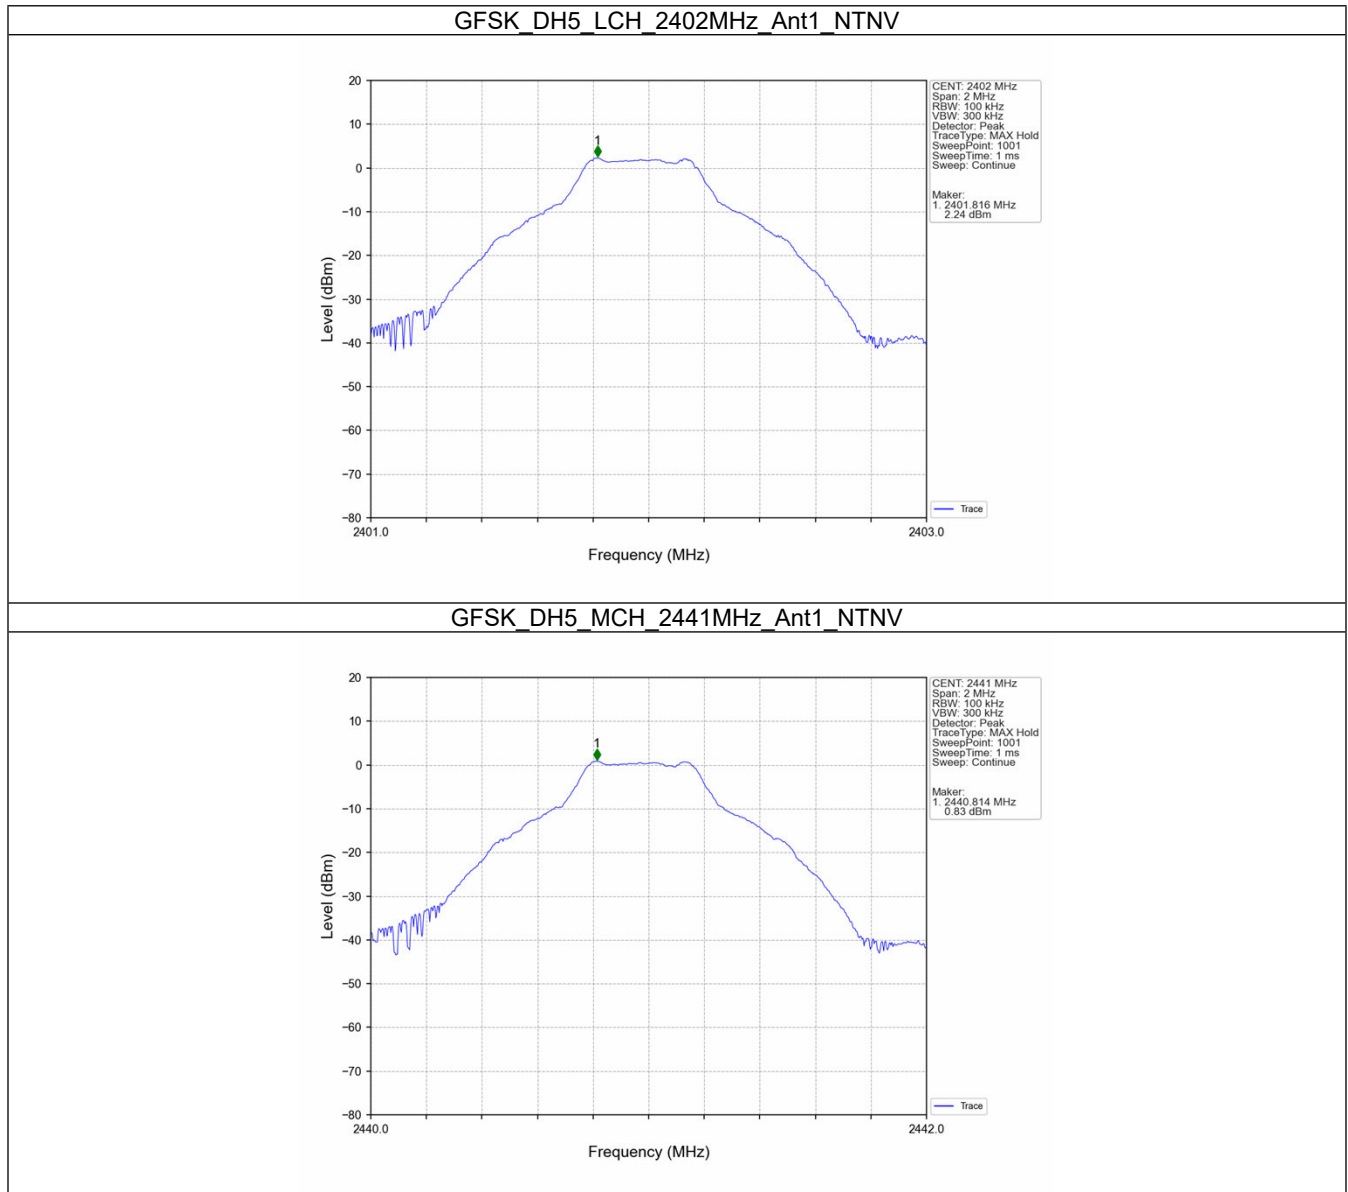


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

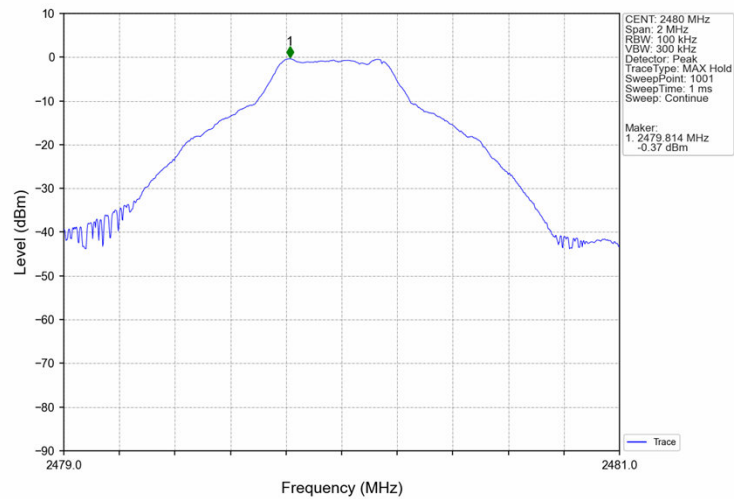


GFSK_DH5_HOPP_2480MHz_Ant1_NTNV

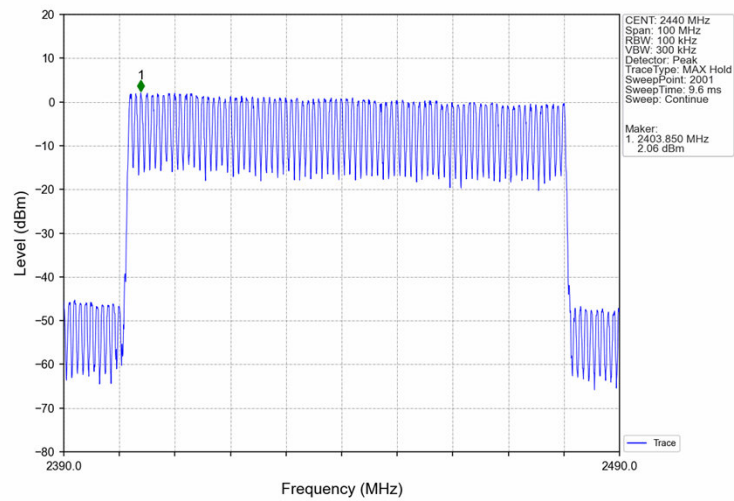


GFSK_DH5_HOPP_Ant1_NTNV

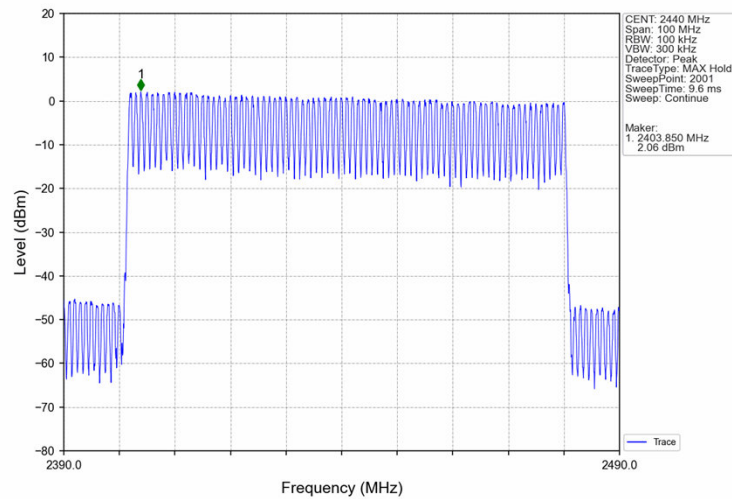


Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

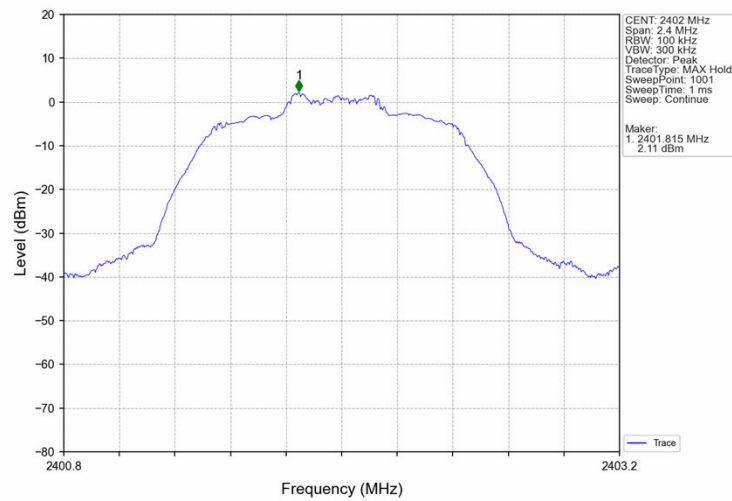


Pi/4DQPSK_2DH5_MCH_2441MHz_Ant1_NTNV

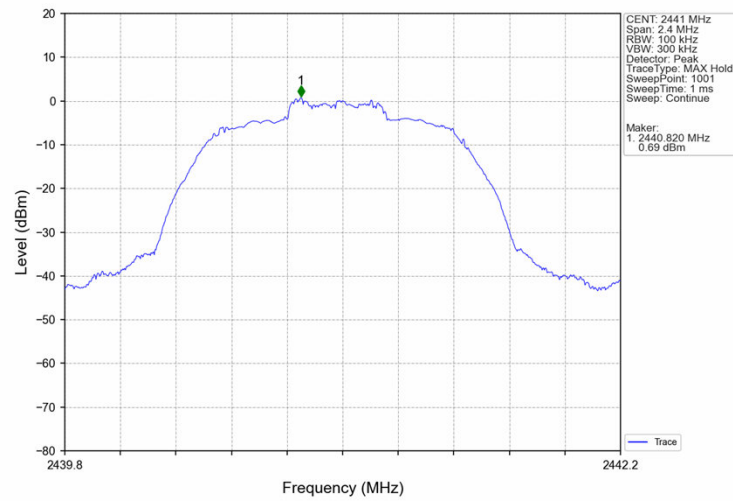


Pi/4DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

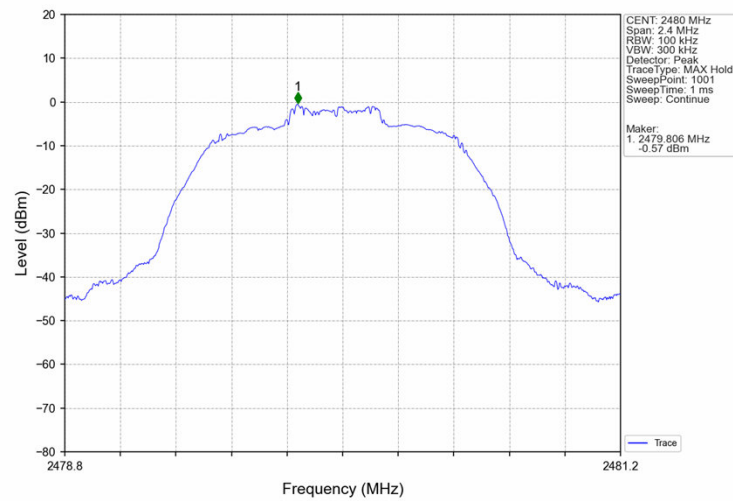


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

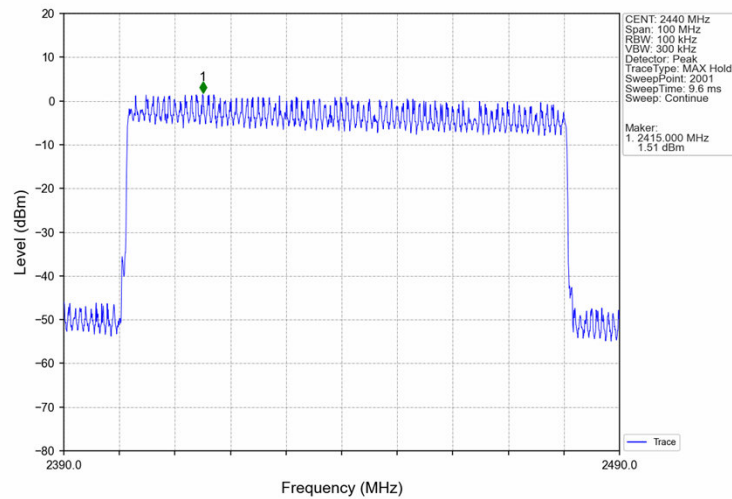


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

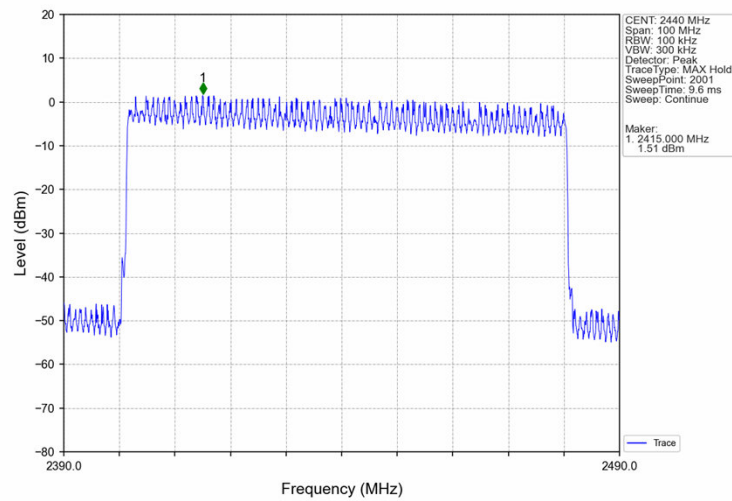


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

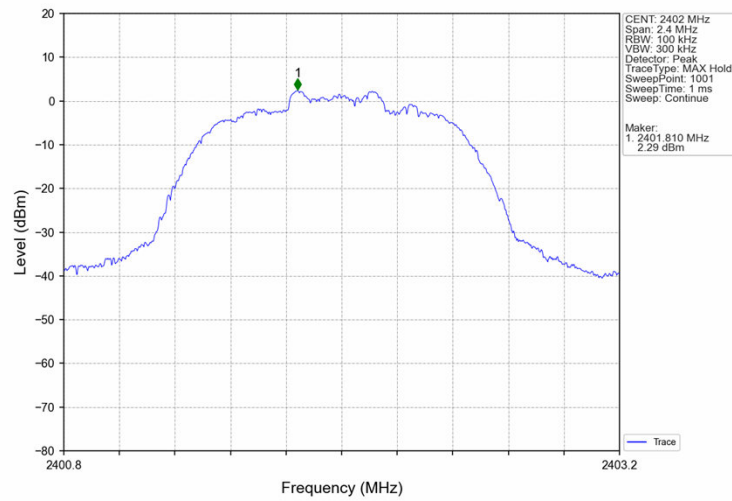


8DPSK_3DH5_MCH_2441MHz_Ant1_NTNV

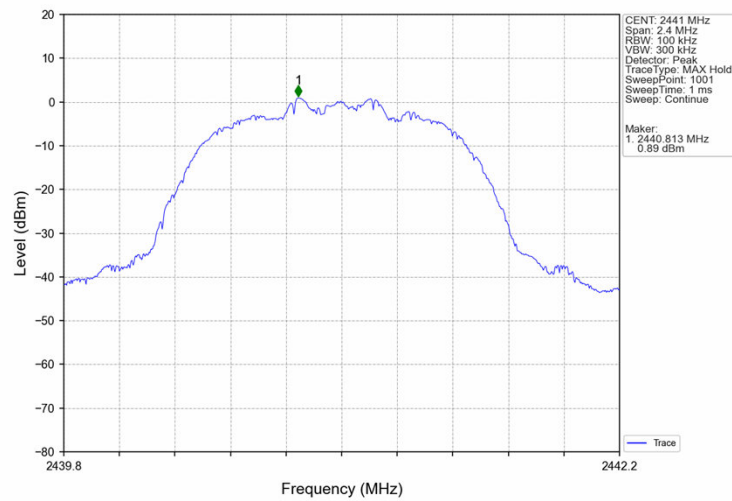


8DPSK_3DH5_HCH_2480MHz_Ant1_NTNV

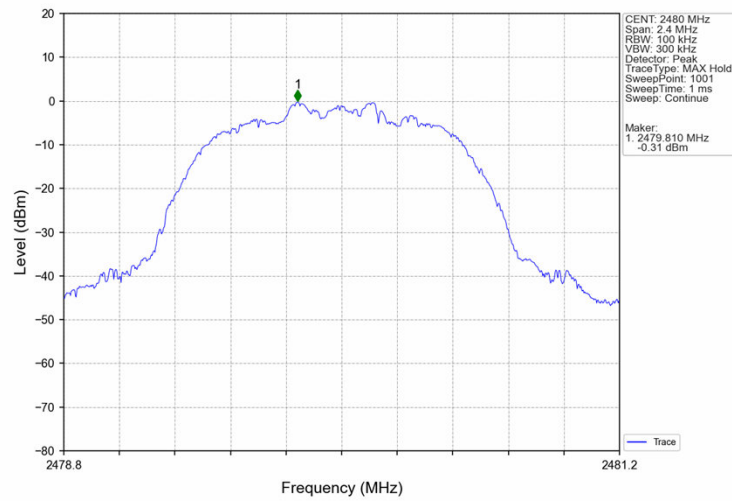

8DPSK_3DH5_HOPP_Ant1_NTNV

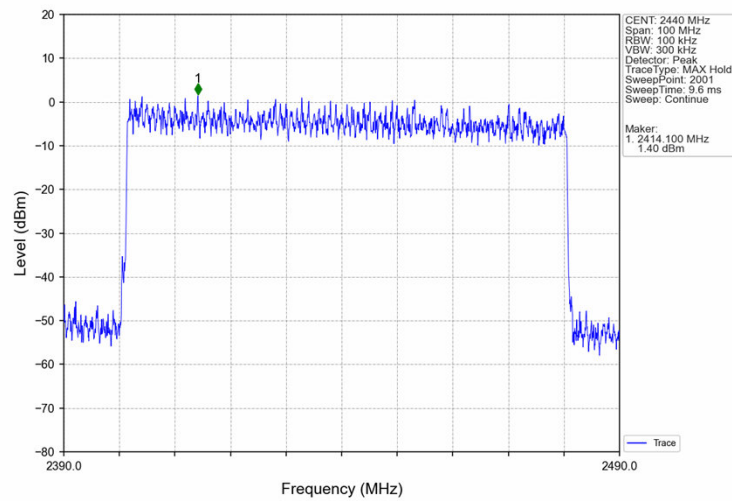


8DPSK_3DH5_HOPP_Ant1_NTNV

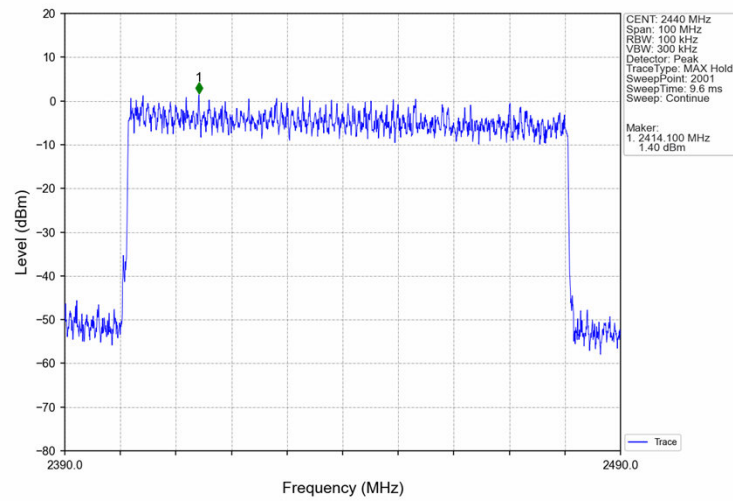


6.2.2 CSE


GFSK_DH5_LCH_2402MHz_Ant1_NTNV

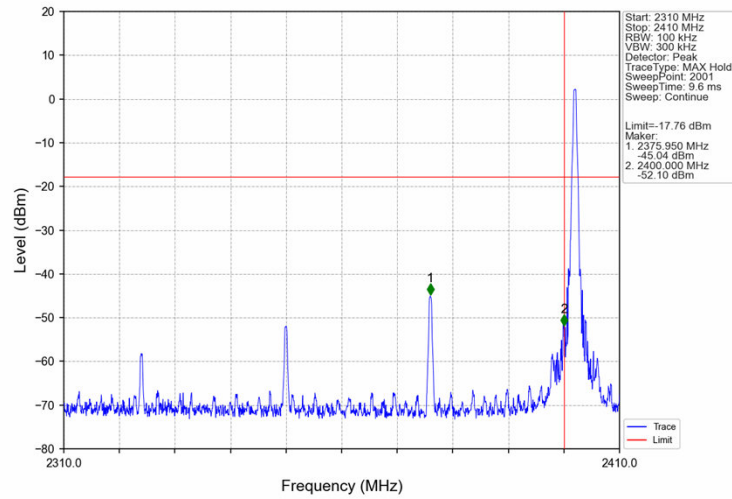


GFSK_DH5_LCH_2402MHz_Ant1_NTNV

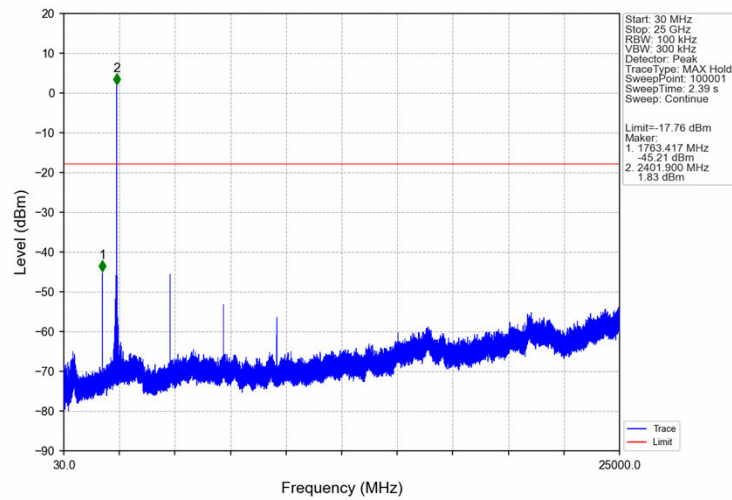


GFSK_DH5_MCH_2441MHz_Ant1_NTNV

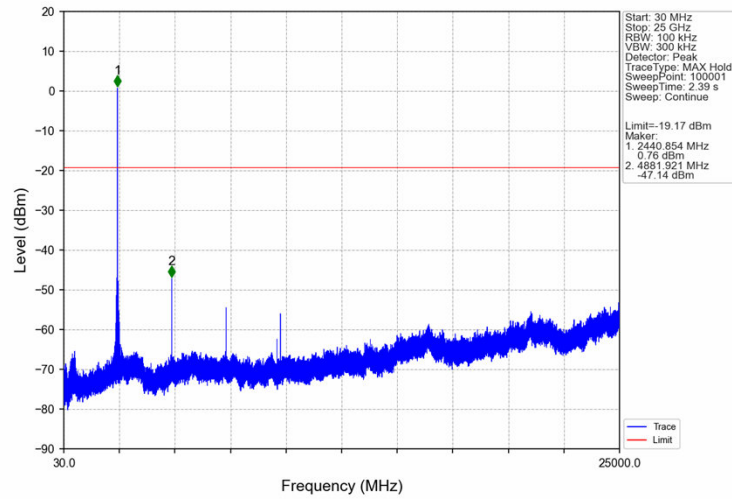


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

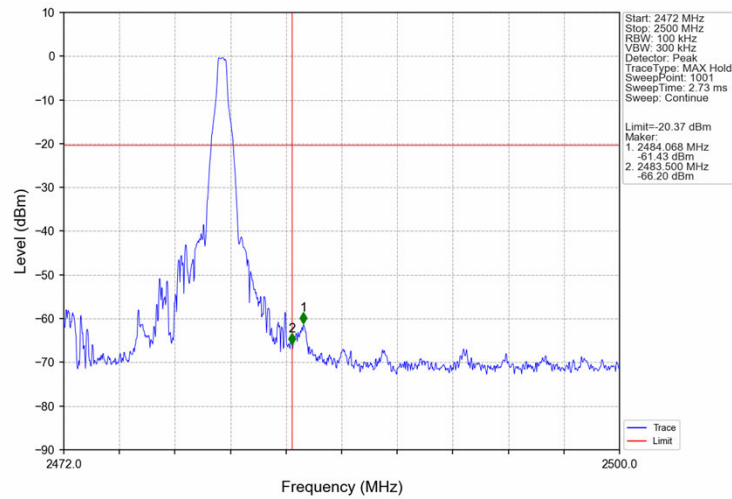


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

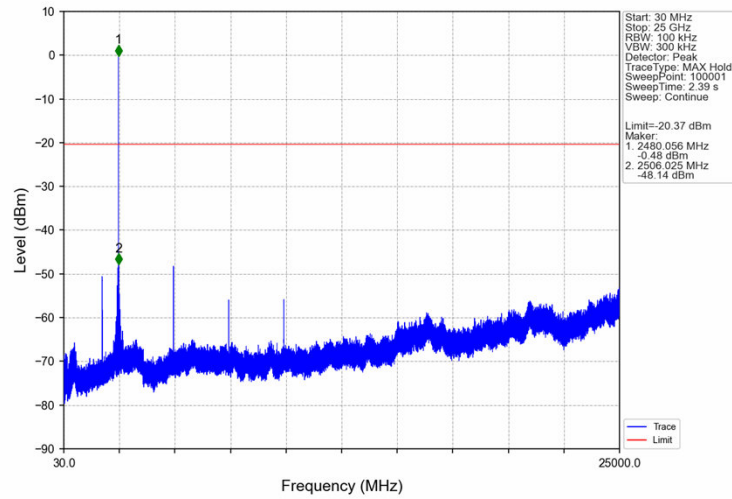


GFSK_DH5_HOPP_Ant1_NTNV

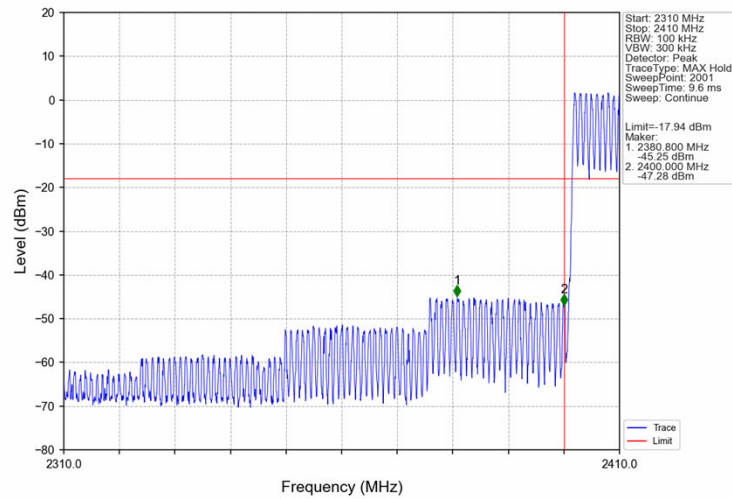


GFSK_DH5_HOPP_Ant1_NTNV

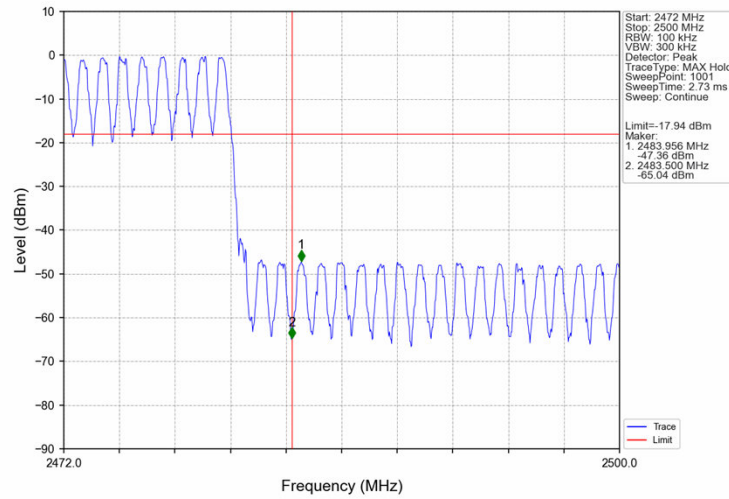


Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

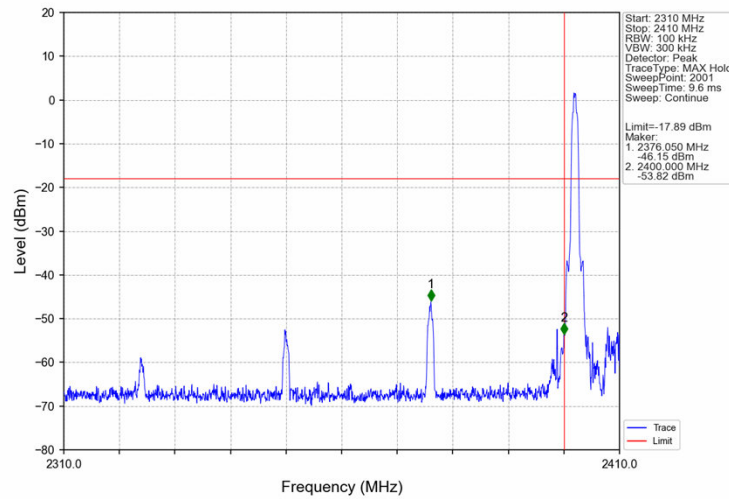


Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

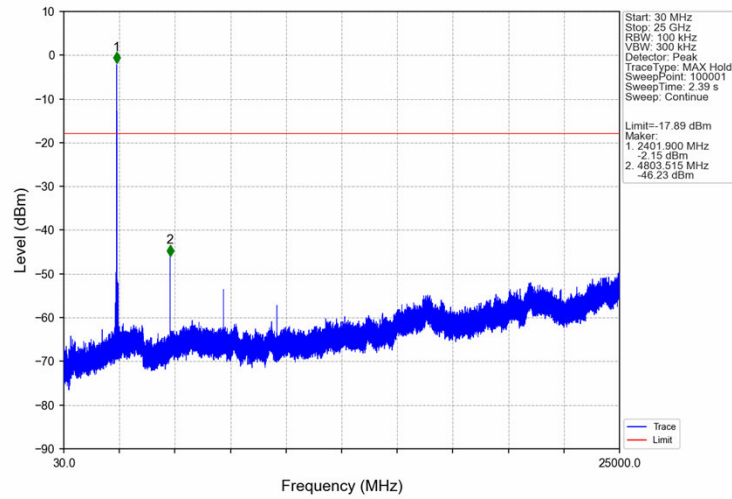


Pi/4DQPSK_2DH5_MCH_2441MHz_Ant1_NTNV

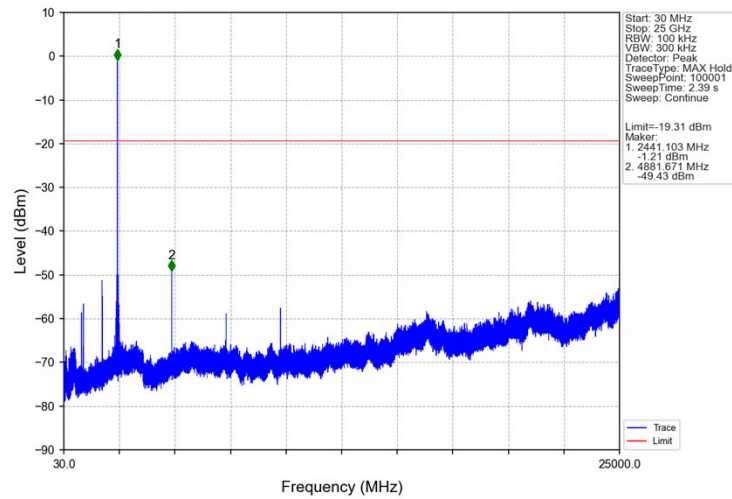


Pi/4DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

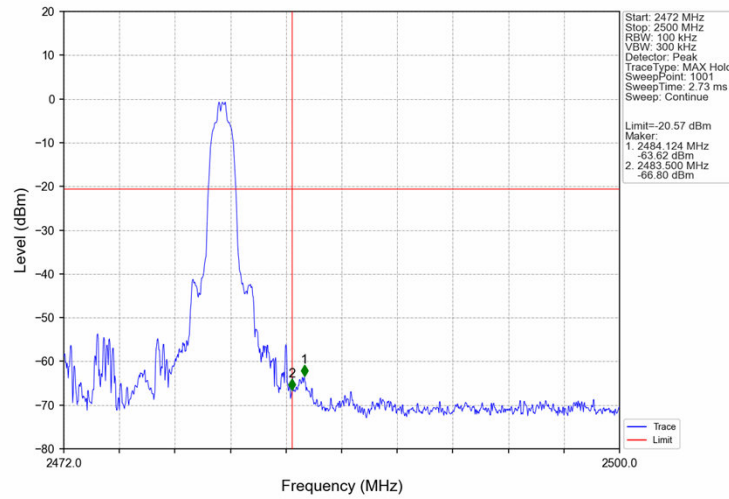


Pi/4DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

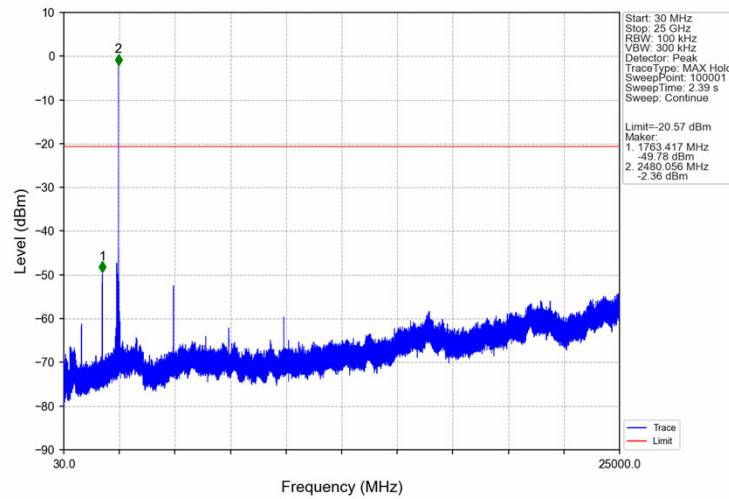


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

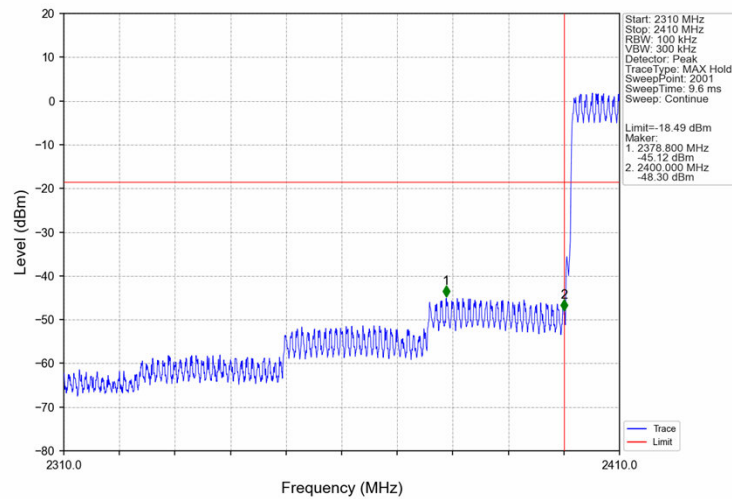


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

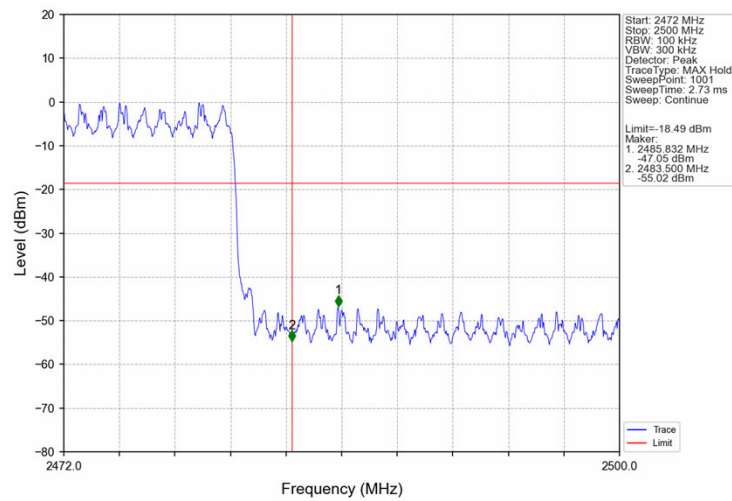


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

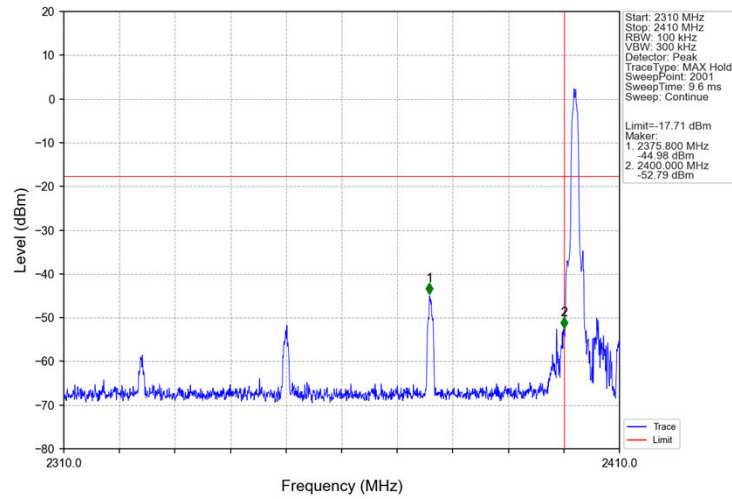


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

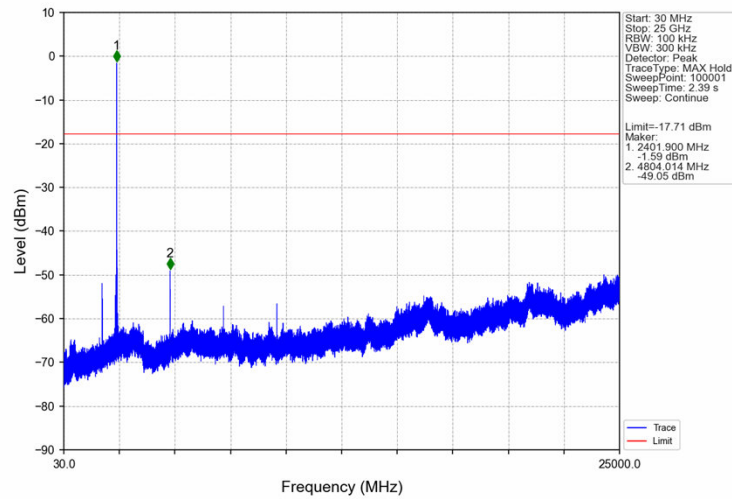


8DPSK_3DH5_MCH_2441MHz_Ant1_NTNV

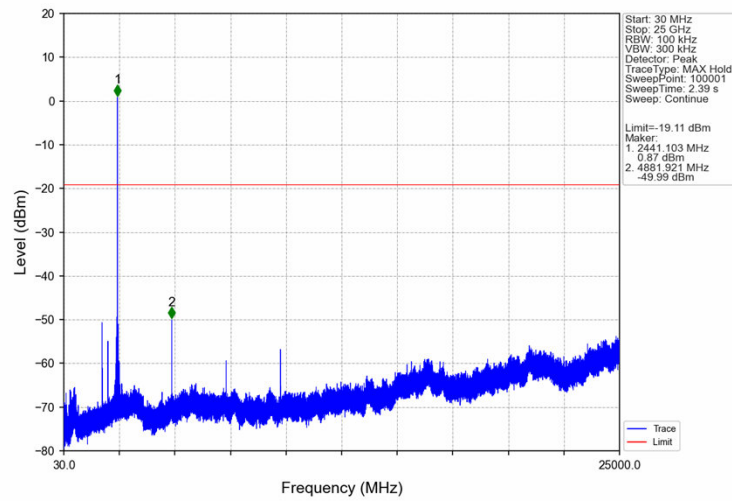


8DPSK_3DH5_HCH_2480MHz_Ant1_NTNV

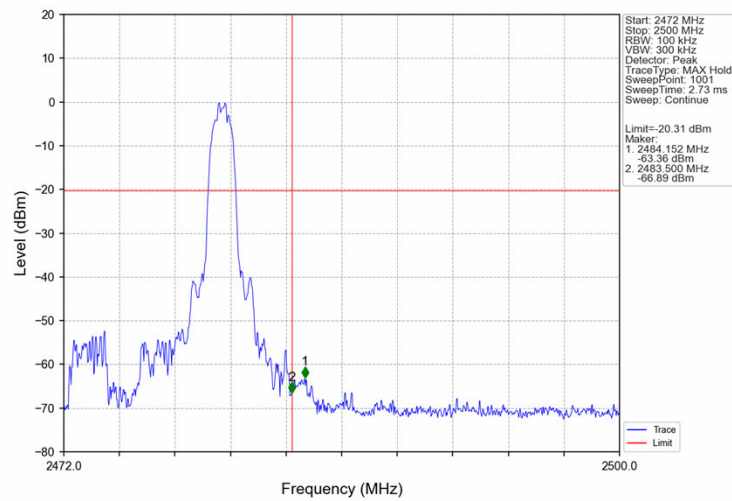

8DPSK_3DH5_HCH_2480MHz_Ant1_NTNV

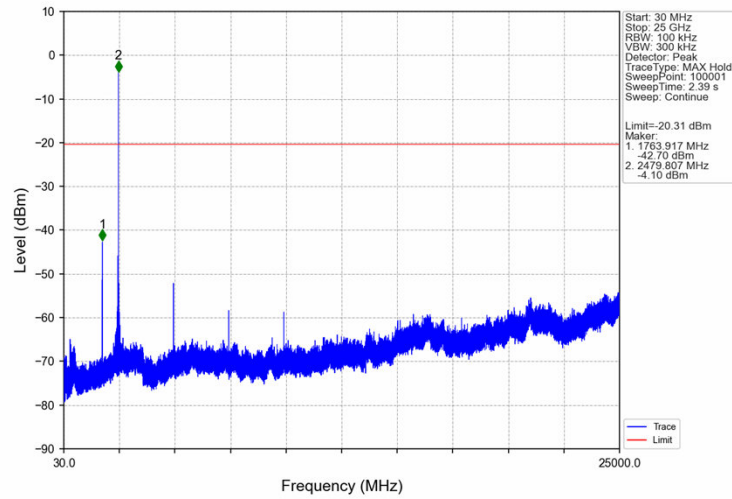

8DPSK_3DH5_HOPP_Ant1_NTNV

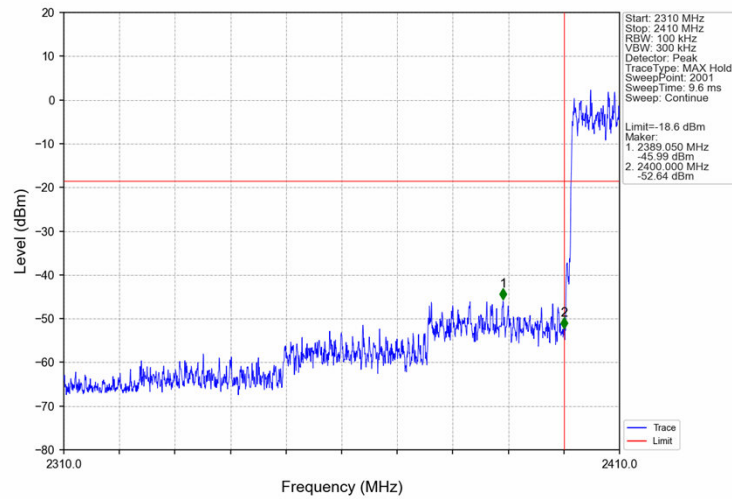

8DPSK_3DH5_HOPP_Ant1_NTNV

