



Appendix D

RF Test Data for 5.2GWIFI (Conducted Measurement)

Product Name: Centegix Integration Gateway

Test Model: CE-INT-04

Environmental Conditions

Temperature:	23.6°C
Relative Humidity:	54.8%
ATM Pressure:	100.0 kPa
Test Engineer:	Jerry Chu
Supervised by:	Can Kun



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



D.1 -26dB Bandwidth

Condition	Mode	Frequency (MHz)	Antenna	-26 dB Bandwidth (MHz)
NVNT	a	5180	Ant2	29.56
NVNT	a	5200	Ant2	29.31
NVNT	a	5240	Ant2	29.39
NVNT	n20	5180	Ant2	27.98
NVNT	n20	5200	Ant2	29.09
NVNT	n20	5240	Ant2	29.49
NVNT	n40	5190	Ant2	49.82
NVNT	n40	5230	Ant2	48.72
NVNT	ac20	5180	Ant2	29.2
NVNT	ac20	5200	Ant2	29.19
NVNT	ac20	5240	Ant2	28.72
NVNT	ac40	5190	Ant2	49.07
NVNT	ac40	5230	Ant2	47.28
NVNT	ac80	5210	Ant2	90.94




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

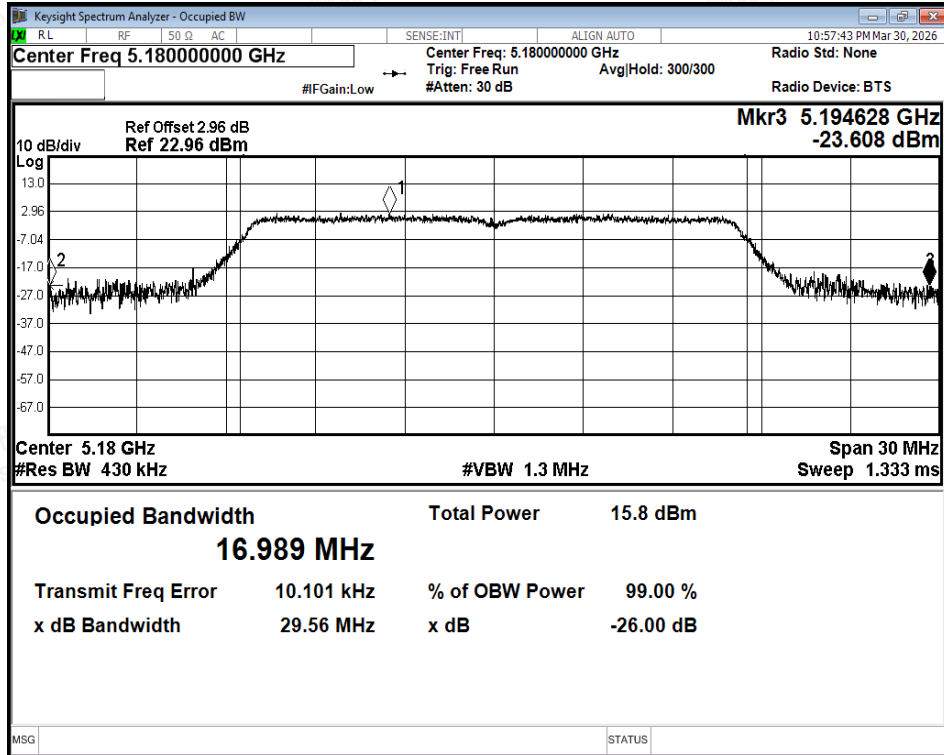

-26dB Bandwidth NVNT a 5180MHz Ant2

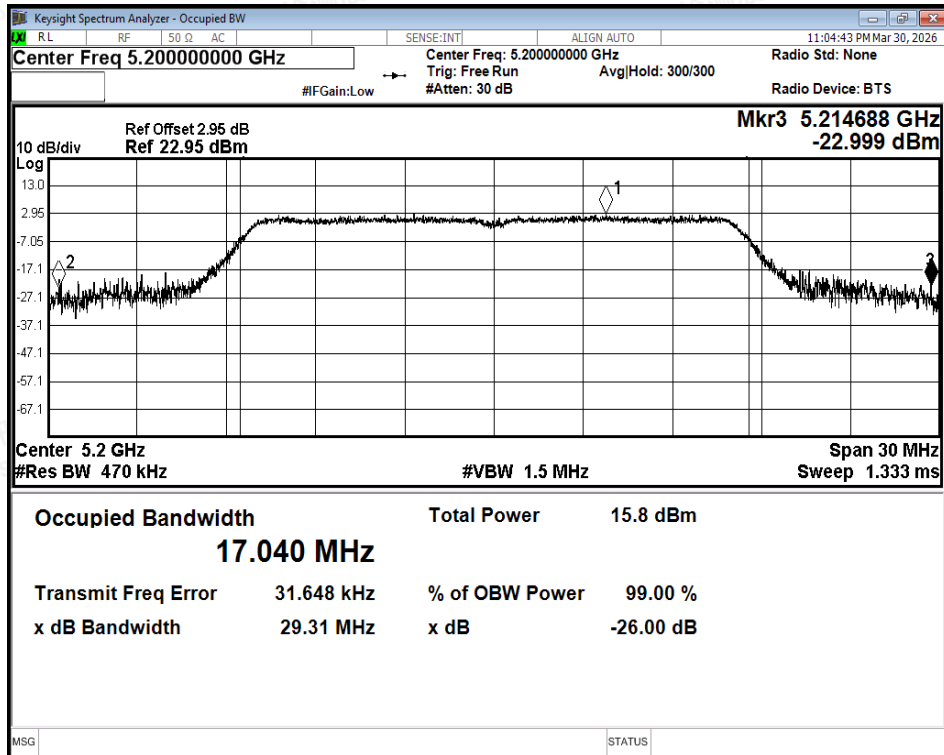

-26dB Bandwidth NVNT a 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

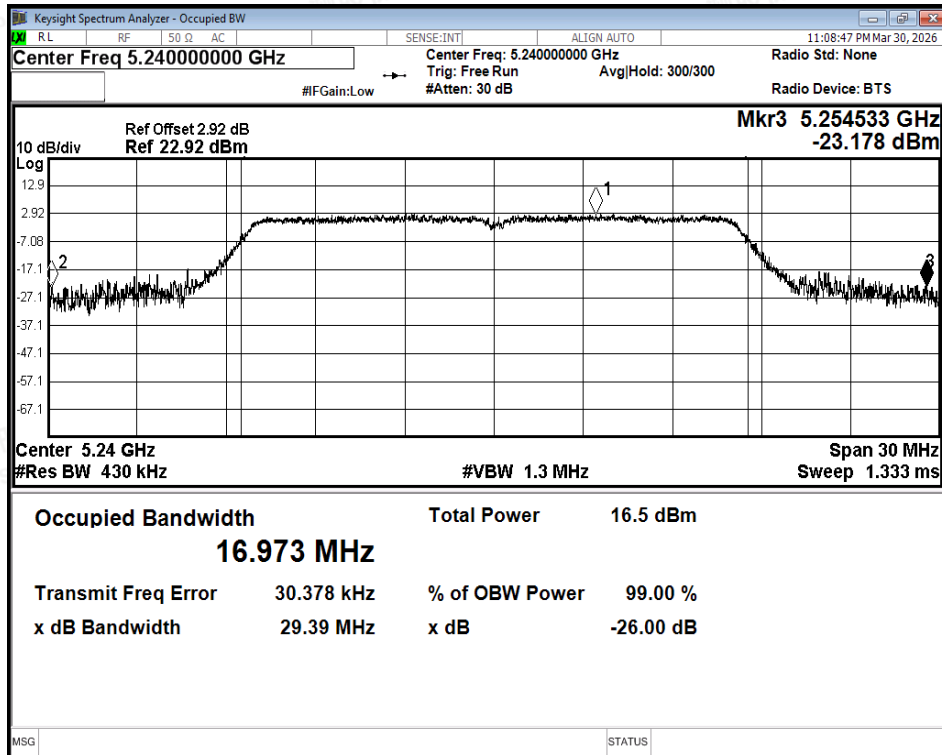

-26dB Bandwidth NVNT a 5240MHz Ant2

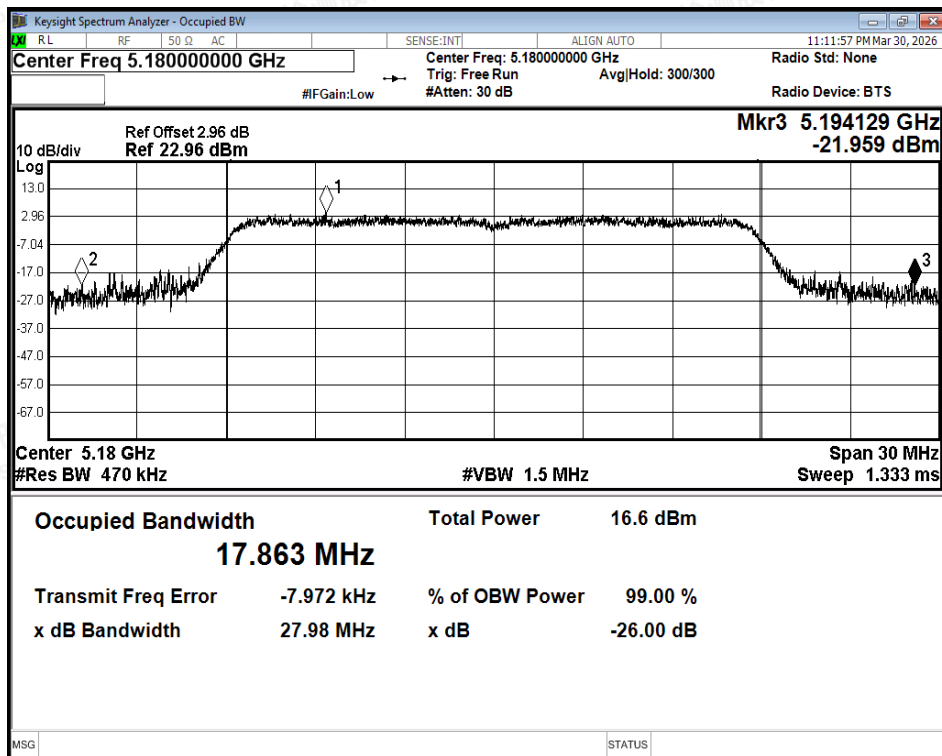

-26dB Bandwidth NVNT n20 5180MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

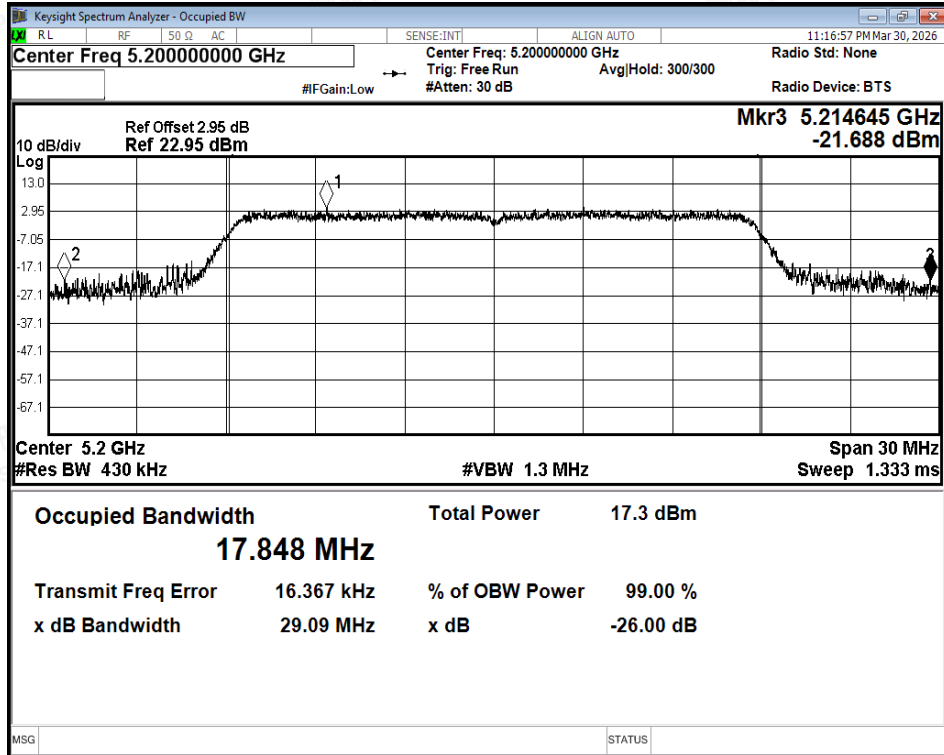

-26dB Bandwidth NVNT n20 5200MHz Ant2

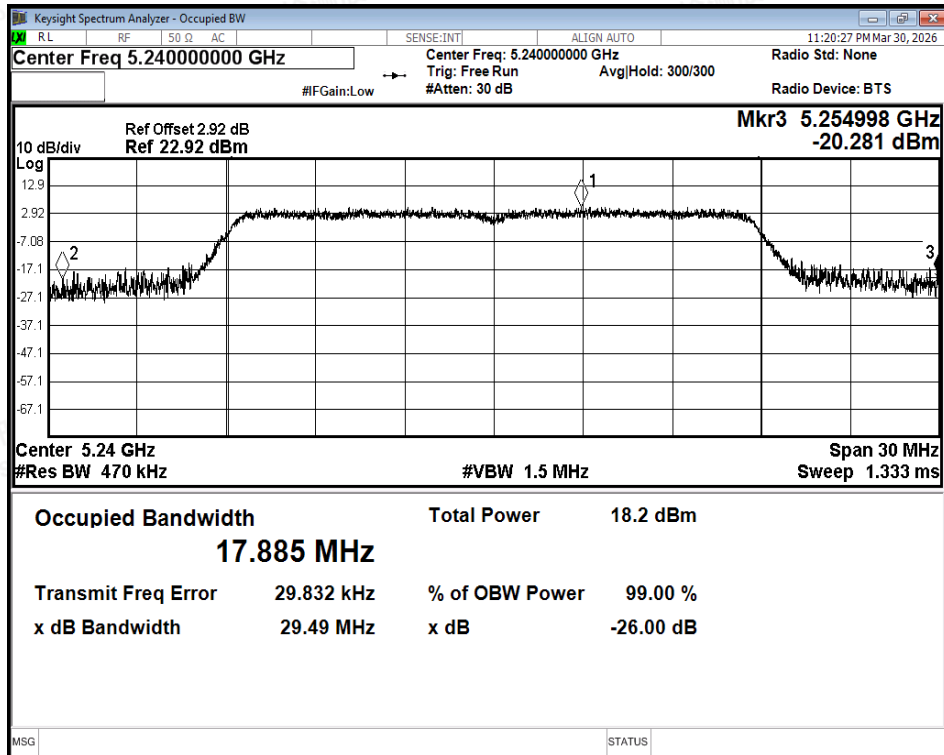

-26dB Bandwidth NVNT n20 5240MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

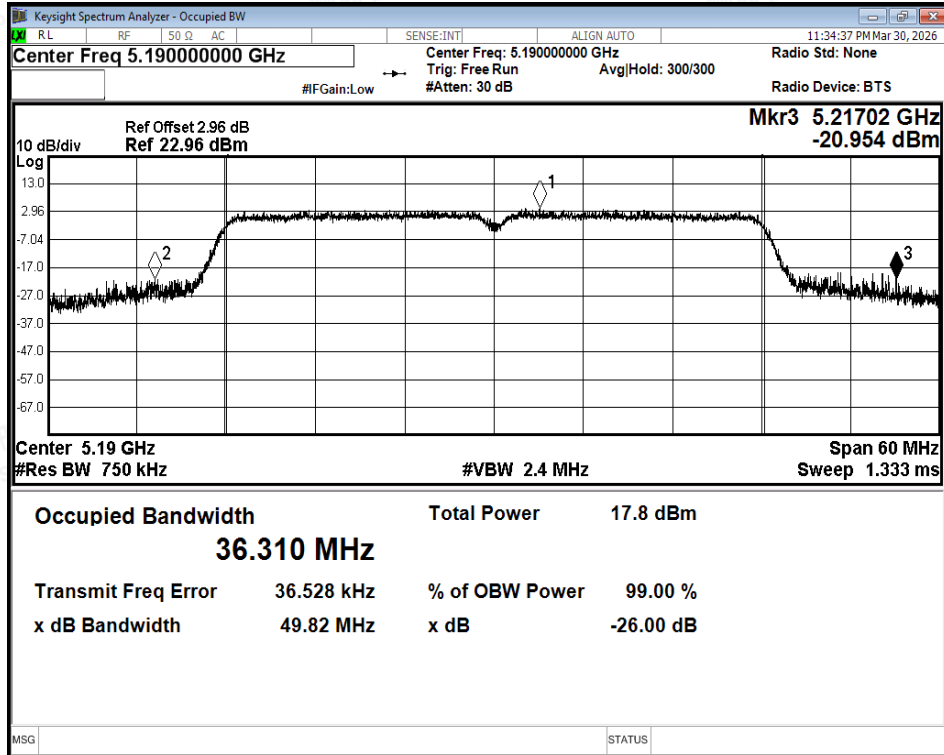

-26dB Bandwidth NVNT n40 5190MHz Ant2

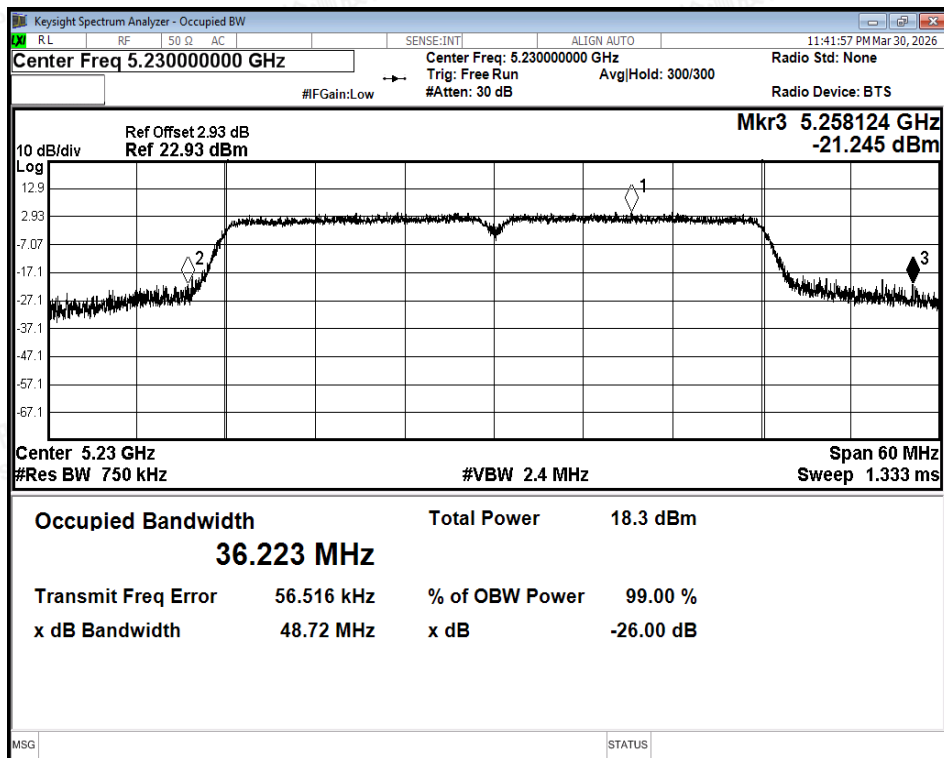

-26dB Bandwidth NVNT n40 5230MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

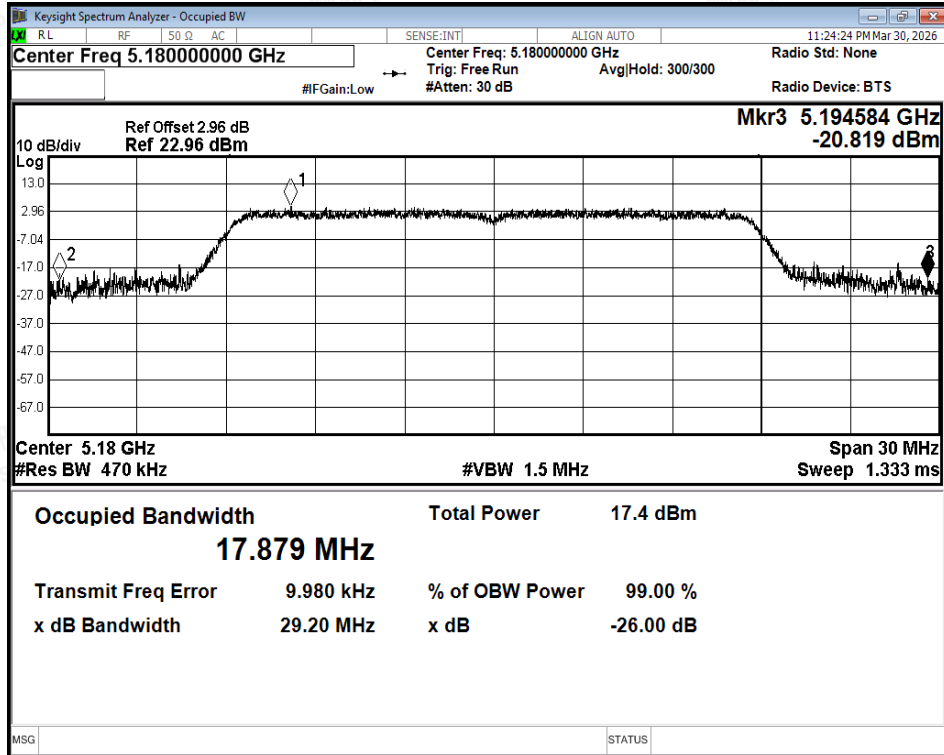

-26dB Bandwidth NVNT ac20 5180MHz Ant2

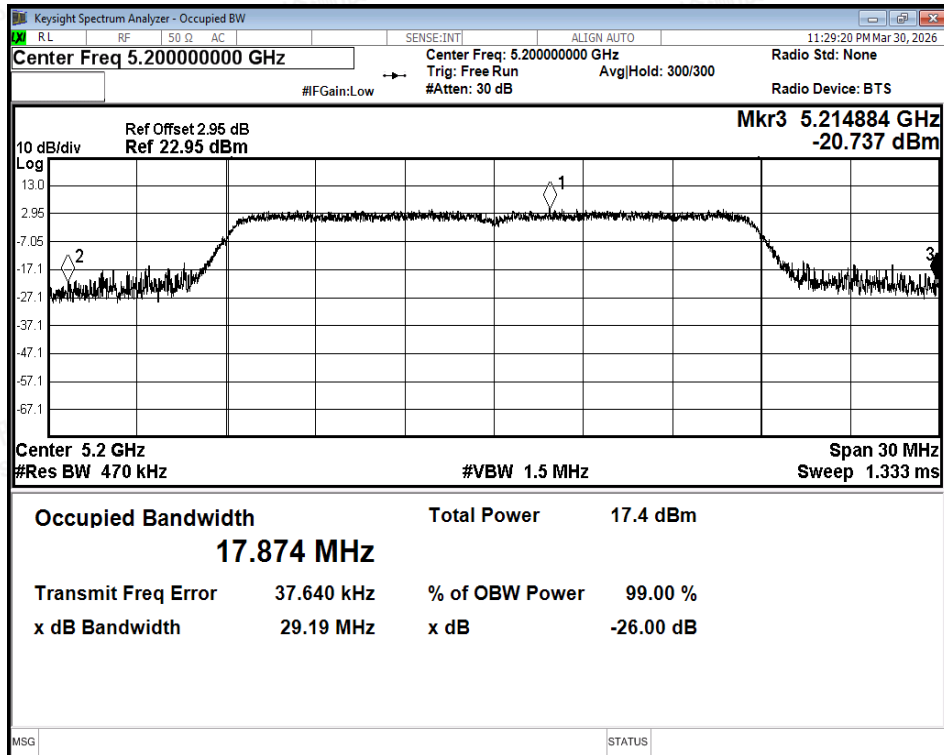

-26dB Bandwidth NVNT ac20 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

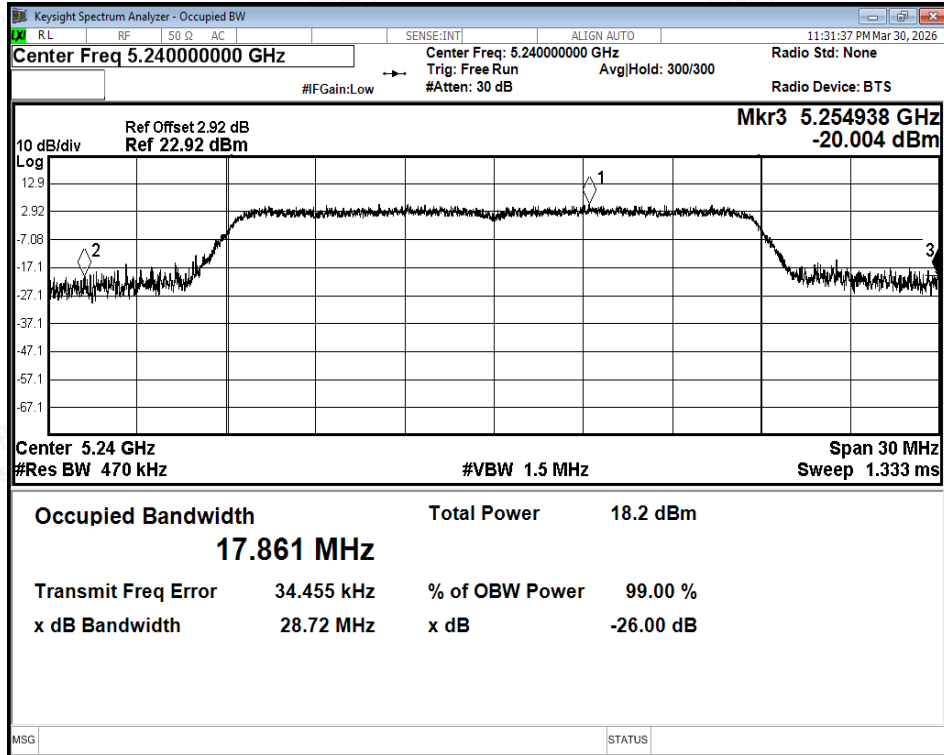

-26dB Bandwidth NVNT ac20 5240MHz Ant2

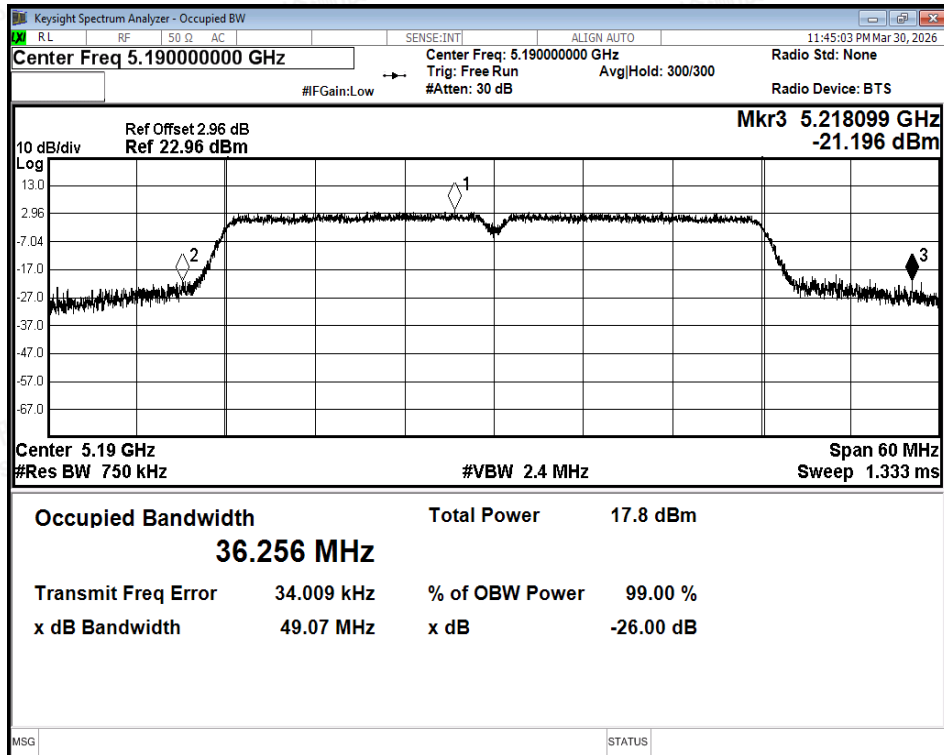

-26dB Bandwidth NVNT ac40 5190MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

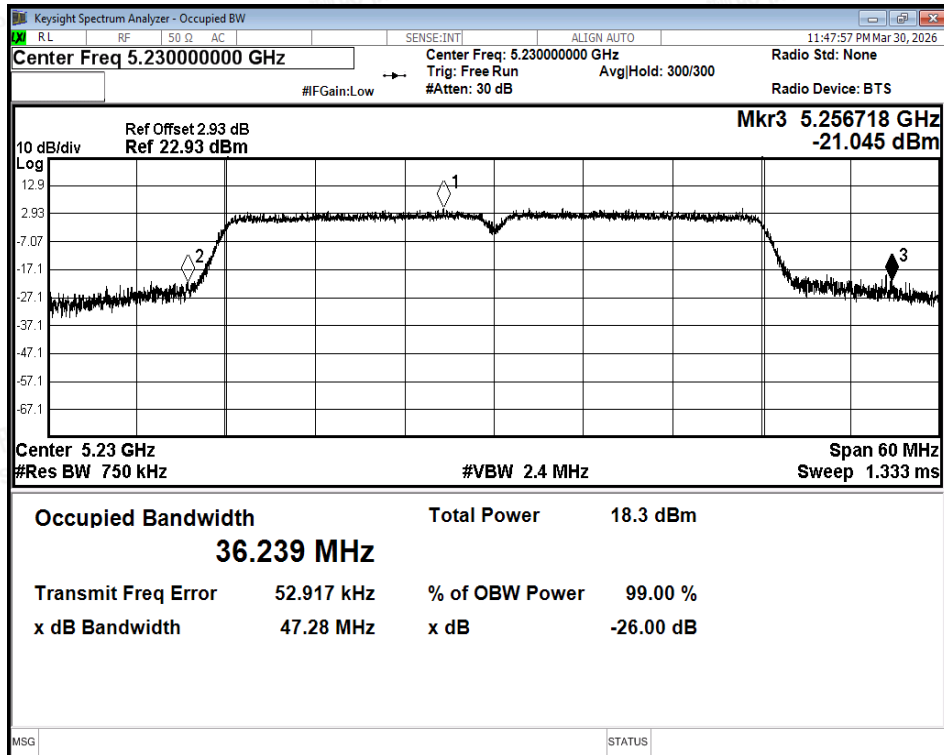

-26dB Bandwidth NVNT ac40 5230MHz Ant2

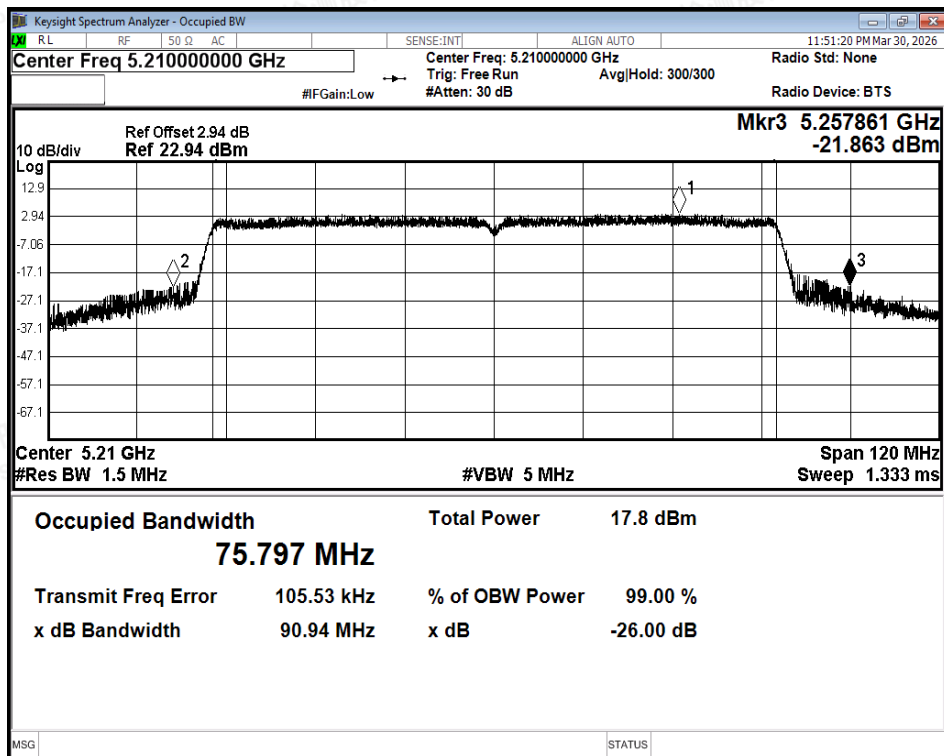

-26dB Bandwidth NVNT ac80 5210MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.2 Maximum Conducted Output Power

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Conducted Power (dBm)	Limit Conducted(dBm)	Verdict
NVNT	a	5180	Ant2	11.13	0.1	11.23	24	Pass
NVNT	a	5200	Ant2	11.16	0.1	11.26	24	Pass
NVNT	a	5240	Ant2	11.95	0.11	12.06	24	Pass
NVNT	n20	5180	Ant2	10.71	0.11	10.82	24	Pass
NVNT	n20	5200	Ant2	10.78	0.13	10.91	24	Pass
NVNT	n20	5240	Ant2	11.49	0.13	11.62	24	Pass
NVNT	n40	5190	Ant2	10.66	0.23	10.89	24	Pass
NVNT	n40	5230	Ant2	11.17	0.23	11.4	24	Pass
NVNT	ac20	5180	Ant2	10.68	0.13	10.81	24	Pass
NVNT	ac20	5200	Ant2	10.71	0.11	10.82	24	Pass
NVNT	ac20	5240	Ant2	11.49	0.11	11.6	24	Pass
NVNT	ac40	5190	Ant2	10.57	0.23	10.8	24	Pass
NVNT	ac40	5230	Ant2	11.1	0.27	11.37	24	Pass
NVNT	ac80	5210	Ant2	9.98	0.46	10.44	24	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




D.3 Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD(dBm/MHz)	Duty Factor (dB)	Total PSD (dBm/MHz)	Limit (dBm/MHz)	Verdict
NVNT	a	5180	Ant2	-1.67	0.1	-1.57	11	Pass
NVNT	a	5200	Ant2	-1.65	0.1	-1.55	11	Pass
NVNT	a	5240	Ant2	-1	0.11	-0.89	11	Pass
NVNT	n20	5180	Ant2	-1.66	0.11	-1.55	11	Pass
NVNT	n20	5200	Ant2	-0.76	0.13	-0.63	11	Pass
NVNT	n20	5240	Ant2	-0.07	0.13	0.06	11	Pass
NVNT	n40	5190	Ant2	-3.97	0.23	-3.74	11	Pass
NVNT	n40	5230	Ant2	-3.29	0.23	-3.06	11	Pass
NVNT	ac20	5180	Ant2	-0.85	0.13	-0.72	11	Pass
NVNT	ac20	5200	Ant2	-0.68	0.11	-0.57	11	Pass
NVNT	ac20	5240	Ant2	0.03	0.11	0.14	11	Pass
NVNT	ac40	5190	Ant2	-3.98	0.23	-3.75	11	Pass
NVNT	ac40	5230	Ant2	-3.3	0.27	-3.03	11	Pass
NVNT	ac80	5210	Ant2	-7.65	0.46	-7.19	11	Pass



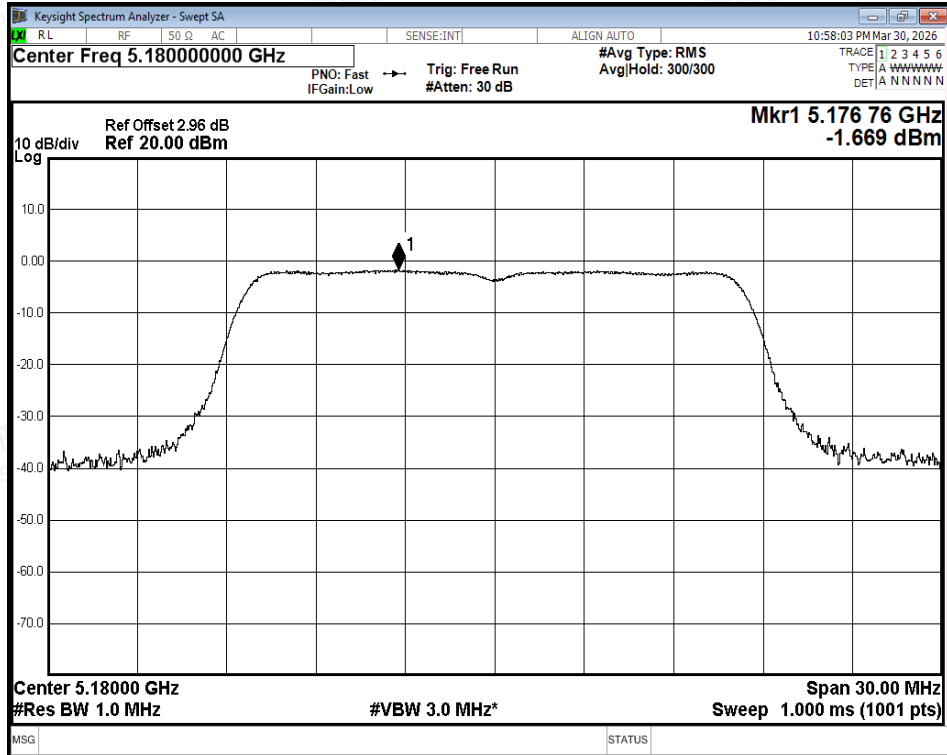

PSD NVNT a 5180MHz Ant2

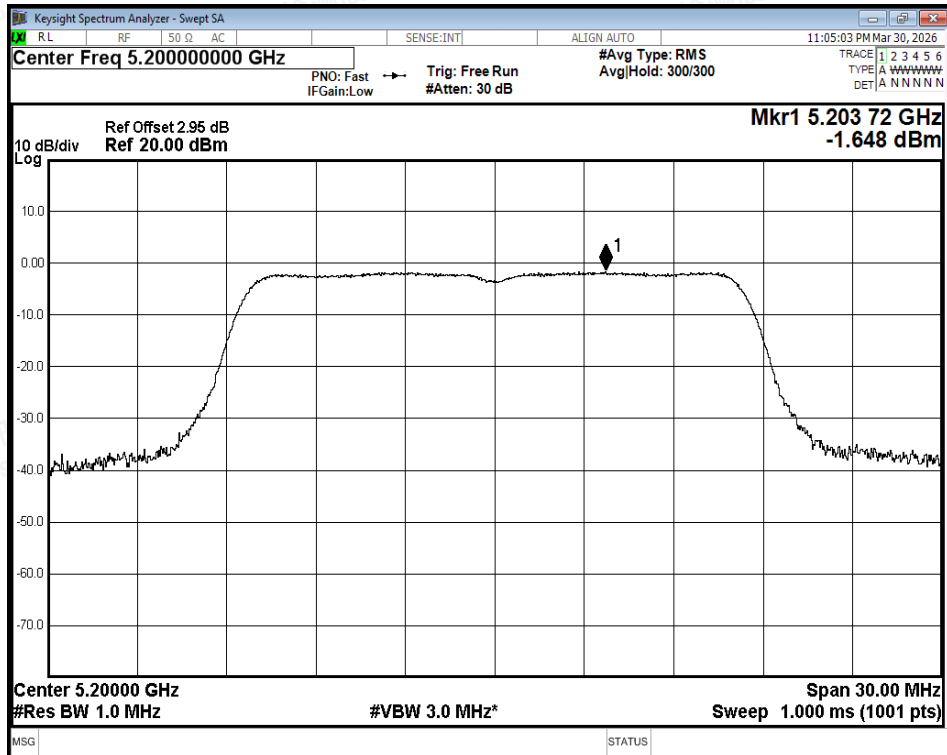

PSD NVNT a 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

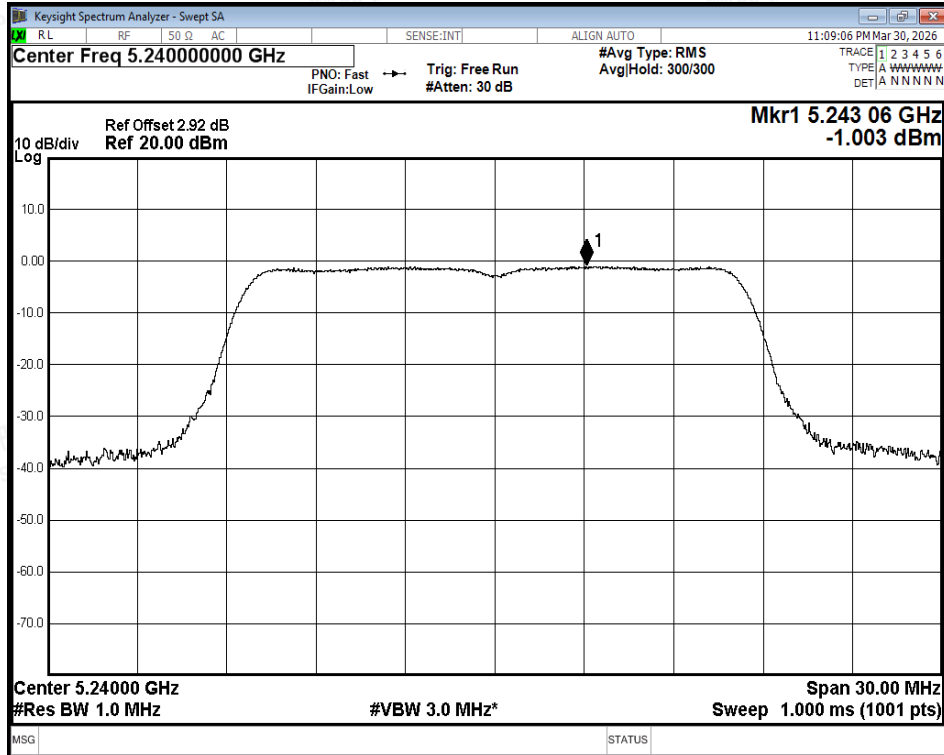

PSD NVNT a 5240MHz Ant2

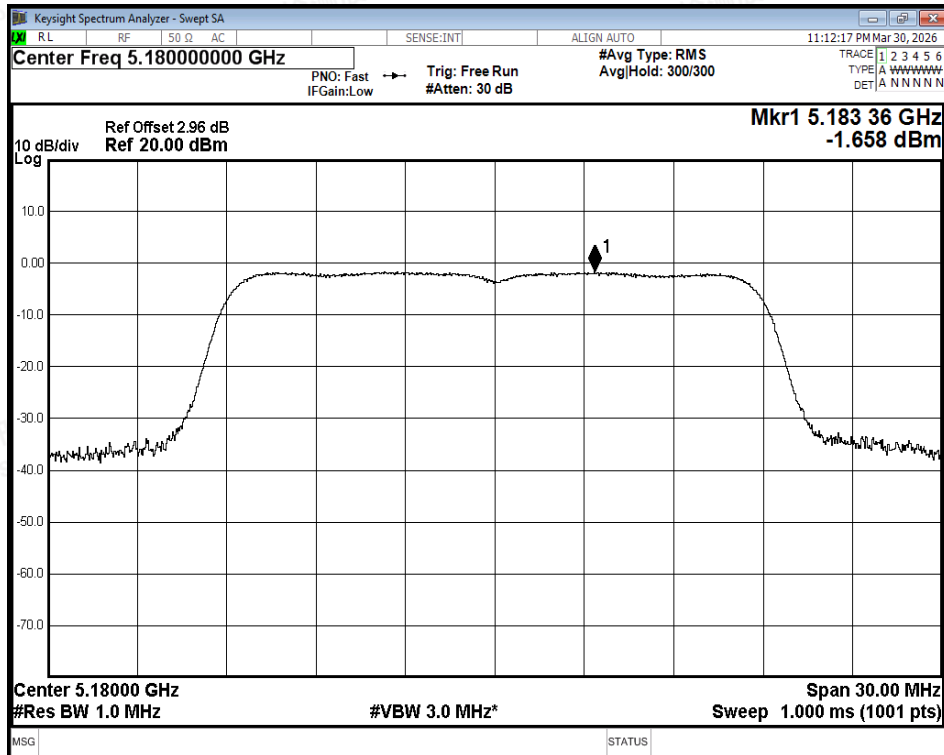

PSD NVNT n20 5180MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

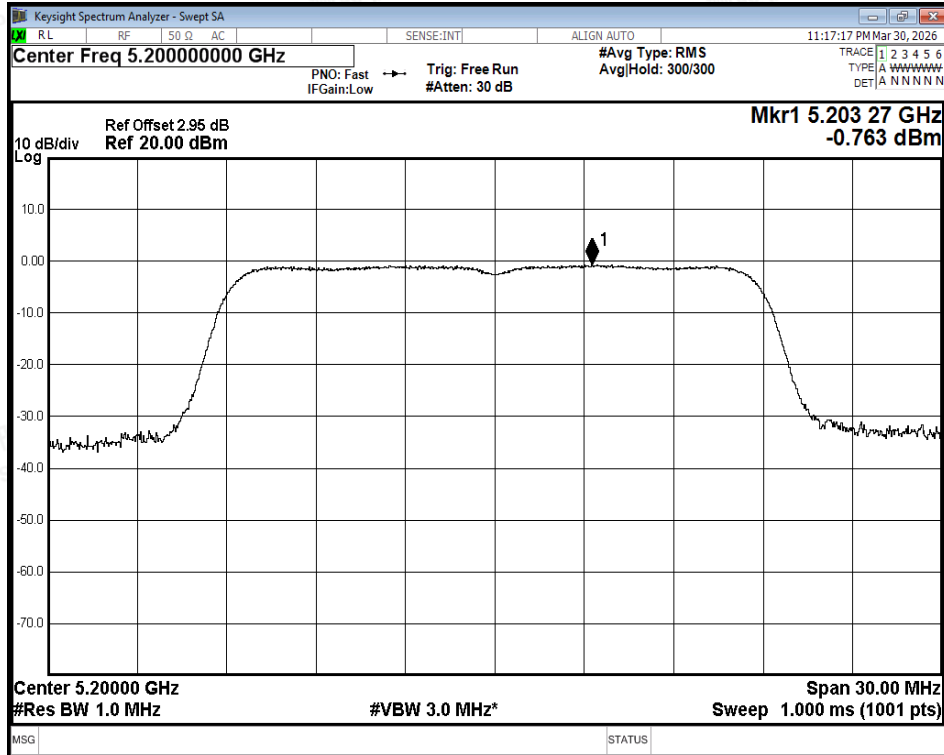

PSD NVNT n20 5200MHz Ant2

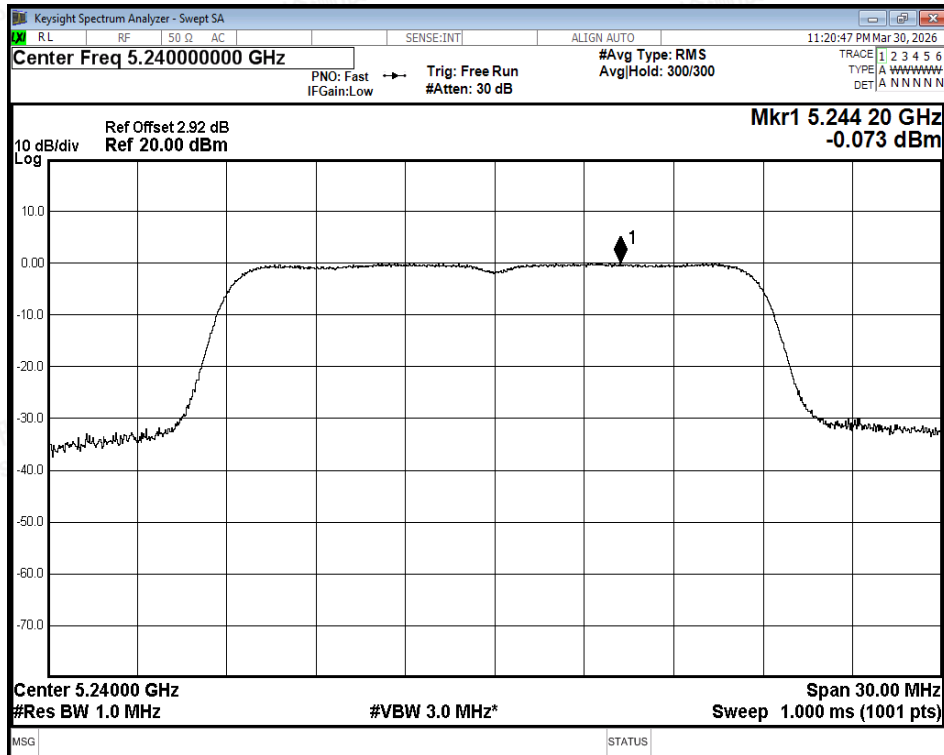

PSD NVNT n20 5240MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

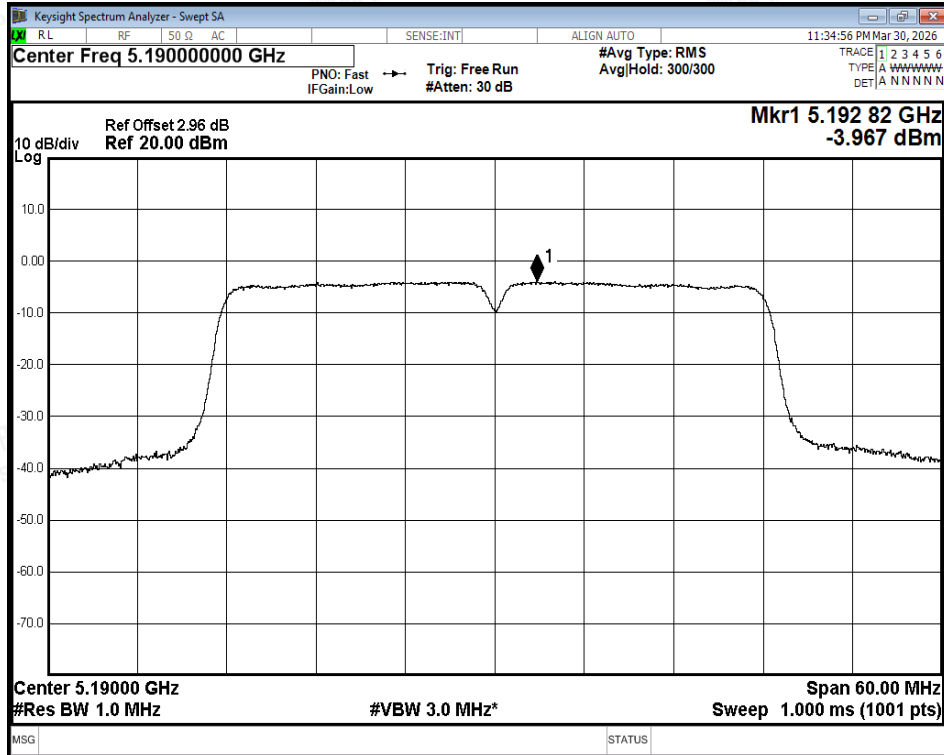

PSD NVNT n40 5190MHz Ant2

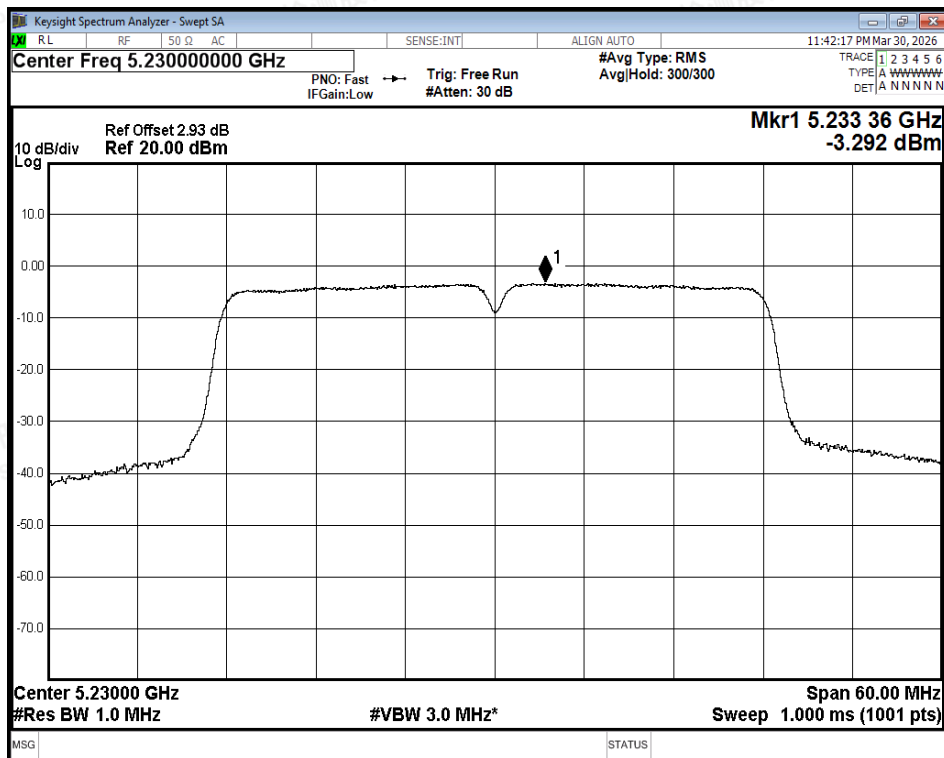

PSD NVNT n40 5230MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

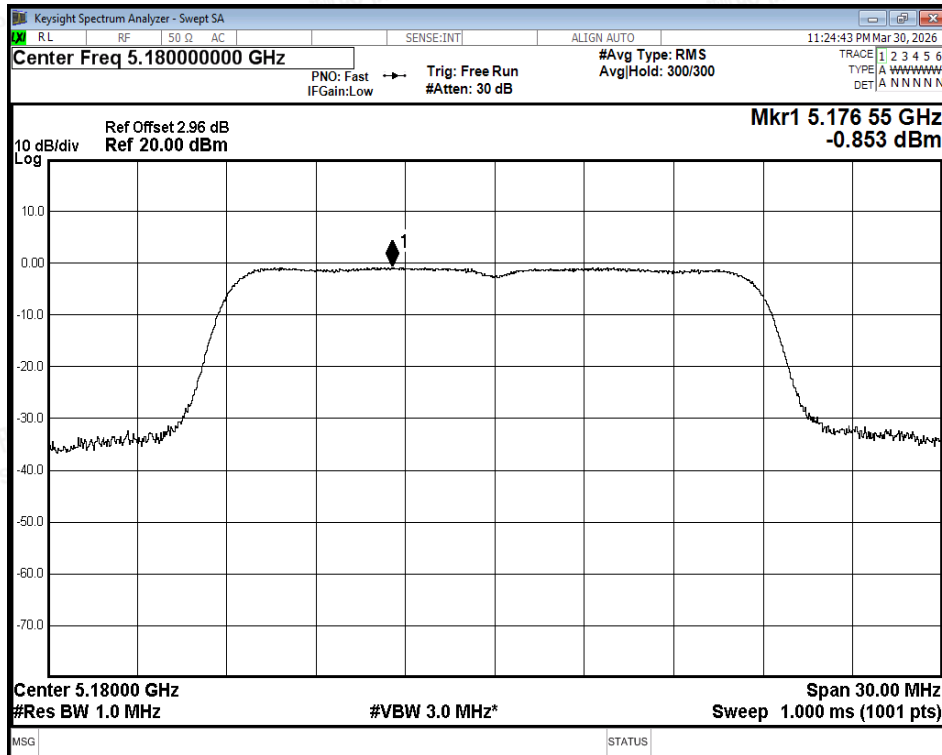

PSD NVNT ac20 5180MHz Ant2

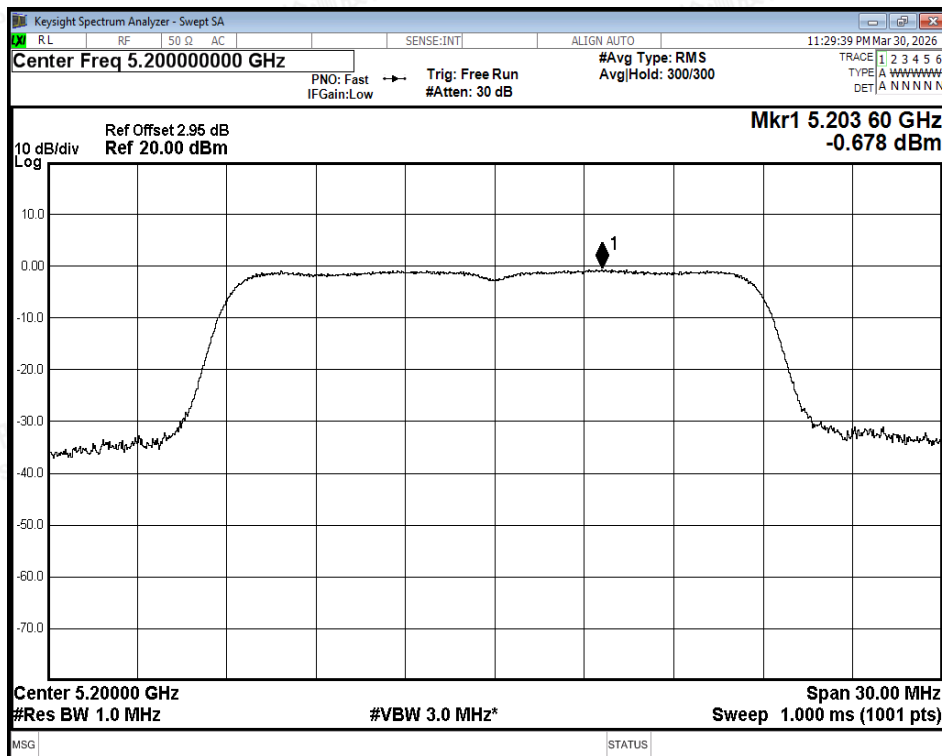

PSD NVNT ac20 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

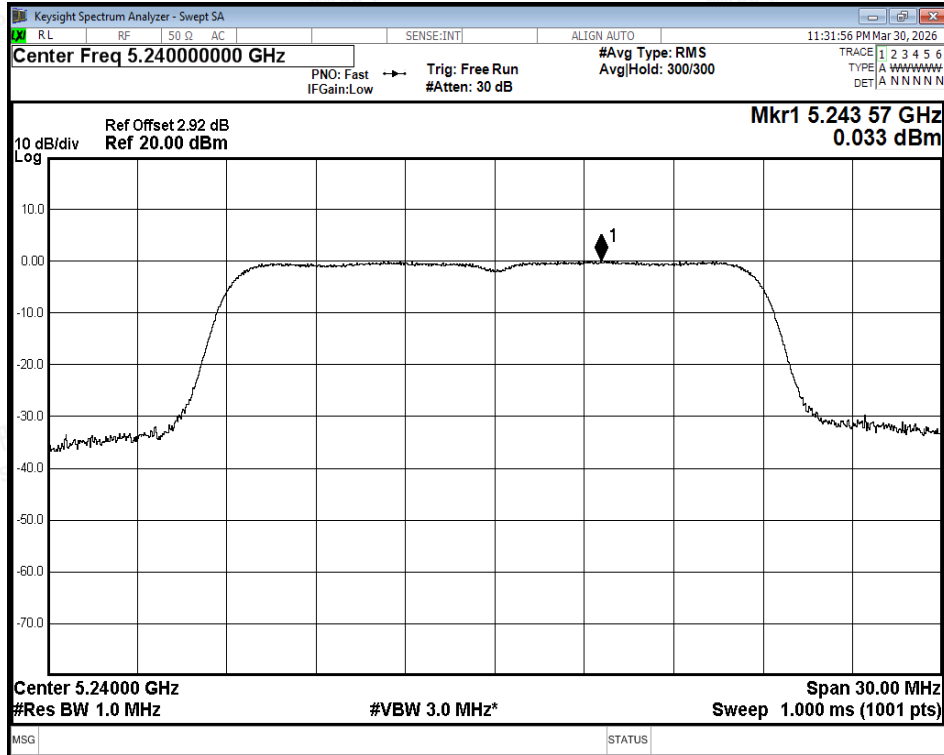

PSD NVNT ac20 5240MHz Ant2

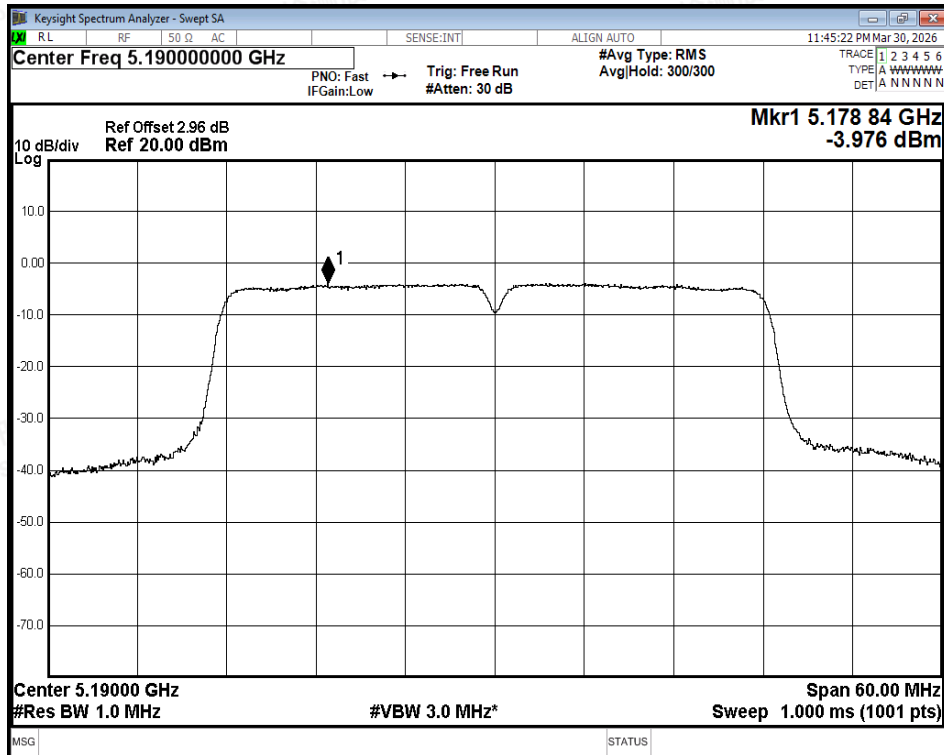

PSD NVNT ac40 5190MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

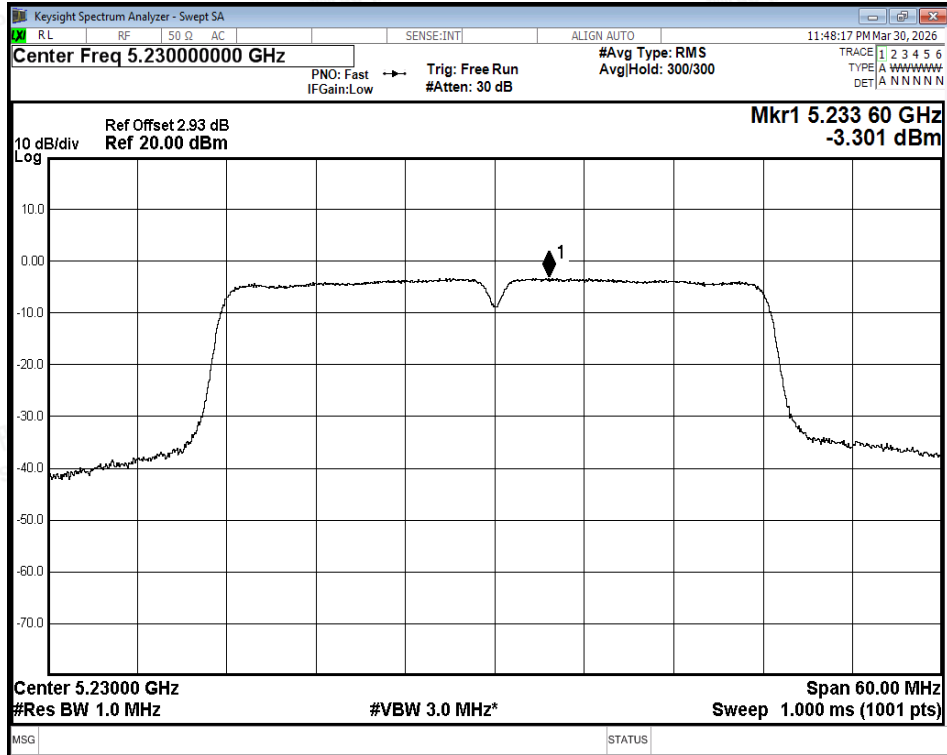

PSD NVNT ac40 5230MHz Ant2

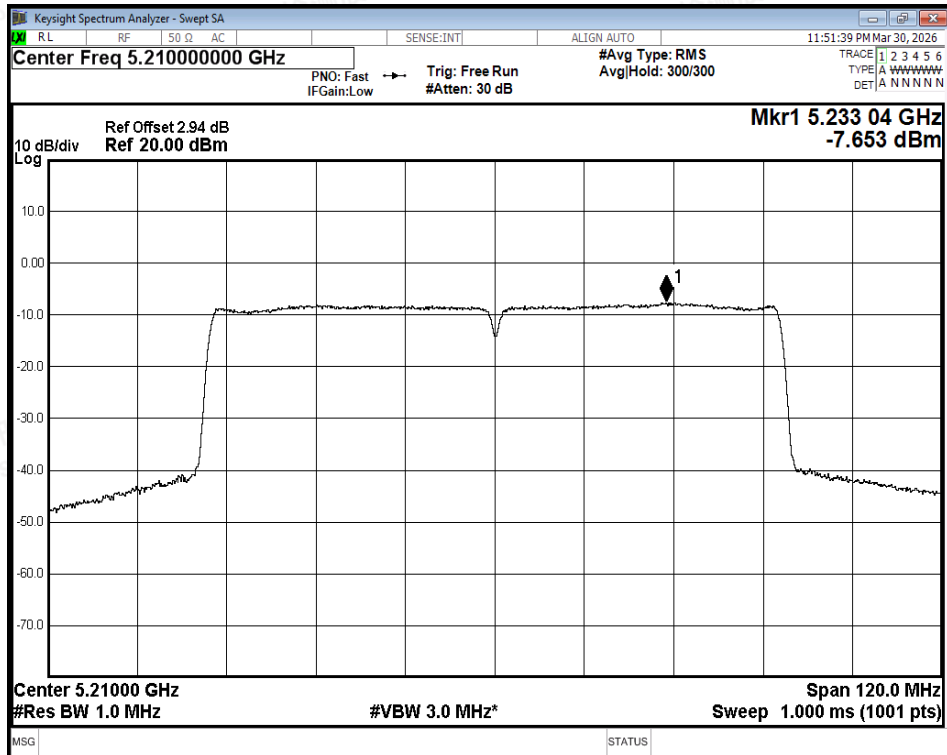

PSD NVNT ac80 5210MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant2	4500	-60.83	2.31	36.71	Peak	68.2	Pass
NVNT	a	5180	Ant2	4500	-68.98	2	28.56	Average	54	Pass
NVNT	a	5180	Ant2	5149.6	-41.01	2	56.53	Peak	68.2	Pass
NVNT	a	5180	Ant2	5149.6	-50.68	2	46.86	Average	54	Pass
NVNT	a	5180	Ant2	5150	-41.37	2	56.17	Peak	68.2	Pass
NVNT	a	5180	Ant2	5150	-49.75	2	47.79	Average	54	Pass
NVNT	a	5240	Ant2	5350	-50.58	2	46.96	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350	-56.99	2	40.55	Average	54	Pass
NVNT	a	5240	Ant2	5436.72	-46.93	2	50.61	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350.8	-56.9	2	40.64	Average	54	Pass
NVNT	a	5240	Ant2	5460	-51.06	2	46.48	Peak	68.2	Pass
NVNT	a	5240	Ant2	5460	-57.38	2	40.16	Average	54	Pass
NVNT	n20	5180	Ant2	4500	-52.03	2	45.51	Peak	68.2	Pass
NVNT	n20	5180	Ant2	4500	-59.02	2	38.52	Average	54	Pass
NVNT	n20	5180	Ant2	5148.9	-42.47	2	55.07	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5149.6	-48.35	2	49.19	Average	54	Pass
NVNT	n20	5180	Ant2	5150	-41.44	2	56.1	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5150	-47.68	2	49.86	Average	54	Pass
NVNT	n20	5240	Ant2	5350	-47.91	2	49.63	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5350	-56.72	2	40.82	Average	54	Pass
NVNT	n20	5240	Ant2	5433.12	-47.42	2	50.12	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5350.8	-56.61	2	40.93	Average	54	Pass
NVNT	n20	5240	Ant2	5460	-51.52	2	46.02	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5460	-57.37	2	40.17	Average	54	Pass
NVNT	n40	5190	Ant2	4500	-61.76	2	35.78	Peak	68.2	Pass
NVNT	n40	5190	Ant2	4500	-68.81	2	28.73	Average	54	Pass
NVNT	n40	5190	Ant2	5148.97	-38.34	2	59.2	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5149.7	-43.99	2	53.55	Average	54	Pass
NVNT	n40	5190	Ant2	5150	-40.07	2	57.47	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5150	-43.7	2	53.84	Average	54	Pass
NVNT	n40	5230	Ant2	5350	-48.37	2	49.17	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5350	-56.89	2	40.65	Average	54	Pass
NVNT	n40	5230	Ant2	5428.14	-46.44	2	51.1	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5350.38	-56.72	2	40.82	Average	54	Pass
NVNT	n40	5230	Ant2	5460	-51.09	2	46.45	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5460	-57.29	2	40.25	Average	54	Pass
NVNT	ac20	5180	Ant2	4500	-52.18	2	45.36	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant2	4500	-59.06	2	38.48	Average	54	Pass
NVNT	ac20	5180	Ant2	5148.9	-39.45	2	58.09	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5149.6	-46.71	2	50.83	Average	54	Pass
NVNT	ac20	5180	Ant2	5150	-43.1	2	54.44	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5150	-46.33	2	51.21	Average	54	Pass
NVNT	ac20	5240	Ant2	5350	-48.65	2	48.89	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350	-56.79	2	40.75	Average	54	Pass
NVNT	ac20	5240	Ant2	5358.72	-47.13	2	50.41	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350.8	-56.59	2	40.95	Average	54	Pass
NVNT	ac20	5240	Ant2	5460	-50.9	2	46.64	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5460	-57.46	2	40.08	Average	54	Pass
NVNT	ac40	5190	Ant2	4500	-50.95	2	46.59	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4500	-58.95	2	38.59	Average	54	Pass
NVNT	ac40	5190	Ant2	5149.7	-39.95	2	57.59	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5149.7	-44.1	2	53.44	Average	54	Pass
NVNT	ac40	5190	Ant2	5150	-41.33	2	56.21	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5150	-43.78	2	53.76	Average	54	Pass
NVNT	ac40	5230	Ant2	5350	-48.7	2	48.84	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350	-56.86	2	40.68	Average	54	Pass
NVNT	ac40	5230	Ant2	5384.94	-47.79	2	49.75	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350.92	-56.82	2	40.72	Average	54	Pass
NVNT	ac40	5230	Ant2	5460	-49.57	2	47.97	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5460	-57.27	2	40.27	Average	54	Pass
NVNT	ac80	5210	Ant2	5350	-48.84	2	48.7	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350	-54.91	2	42.63	Average	54	Pass
NVNT	ac80	5210	Ant2	5383.77	-47.1	2	50.44	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5353.41	-54.73	2	42.81	Average	54	Pass
NVNT	ac80	5210	Ant2	5460	-49.67	2	47.87	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5460	-56.98	2	40.56	Average	54	Pass
NVNT	ac80	5210	Ant2	4500	-51.01	2	46.53	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	4500	-58.7	2	38.84	Average	54	Pass
NVNT	ac80	5210	Ant2	5148.59	-41.22	2	56.32	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5149.38	-45.75	2	51.79	Average	54	Pass
NVNT	ac80	5210	Ant2	5150	-40.75	2	56.79	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5150	-45.48	2	52.06	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

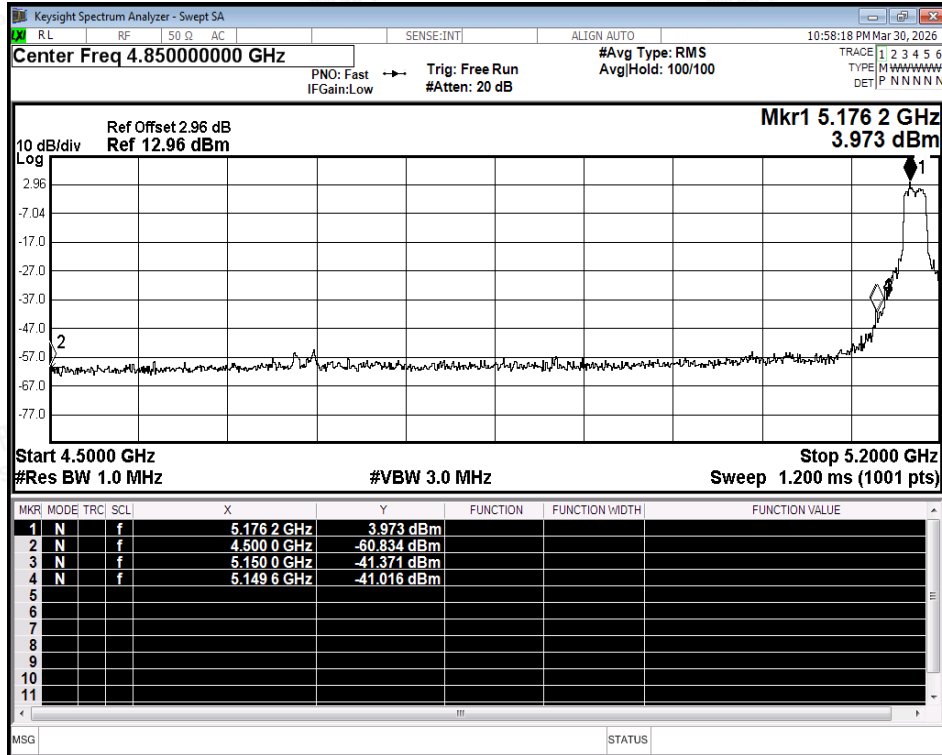

Restrict Band NVNT a 5180MHz Ant2 Peak

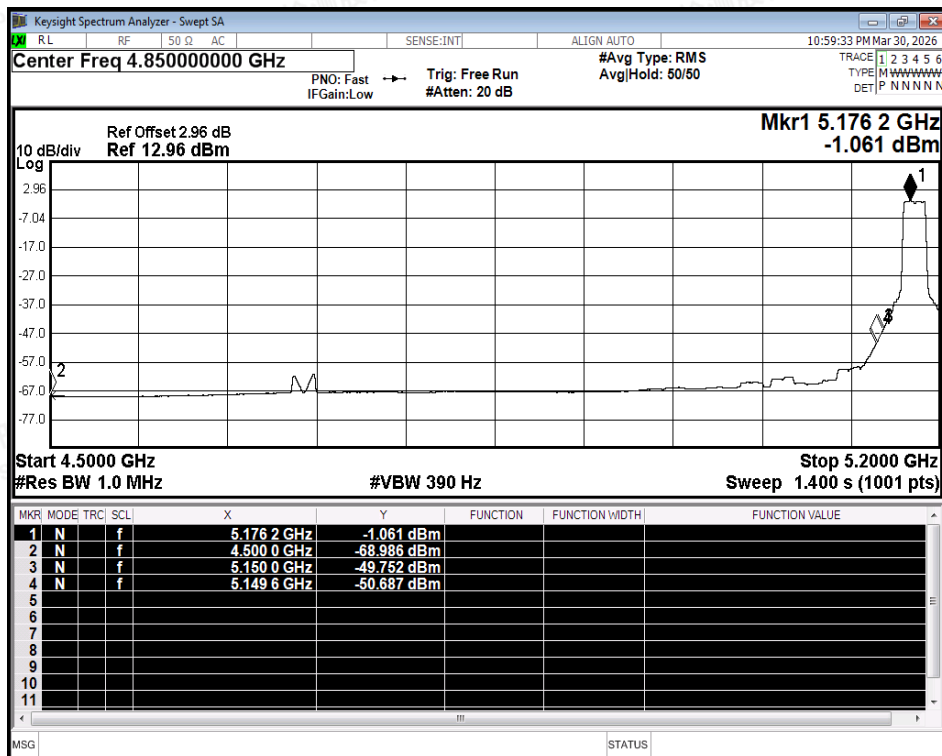

Restrict Band NVNT a 5180MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

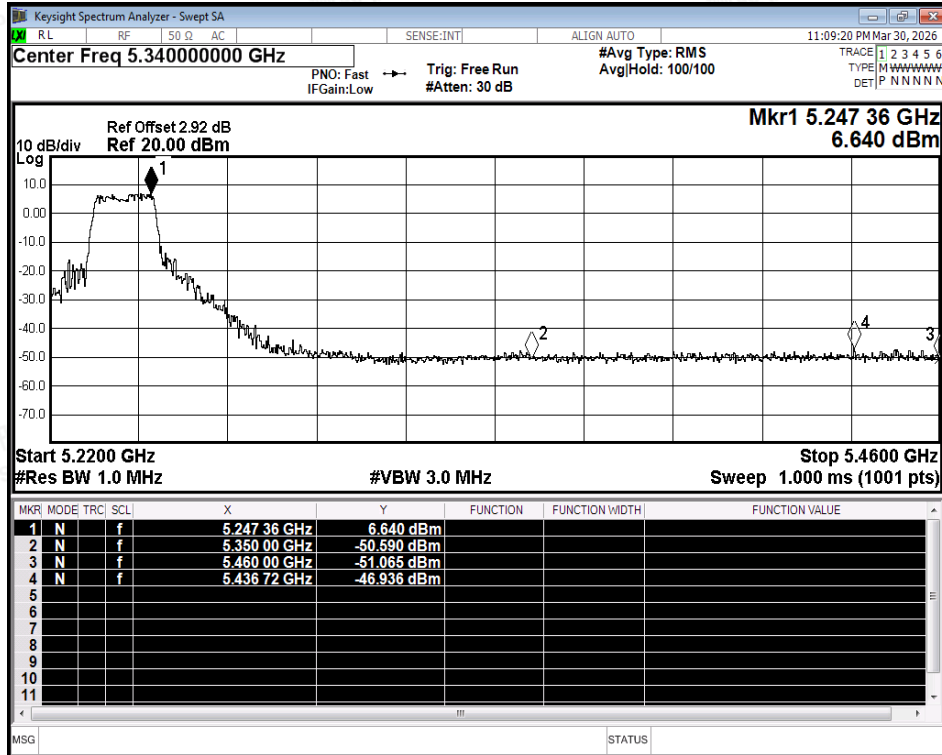

Restrict Band NVNT a 5240MHz Ant2 Peak

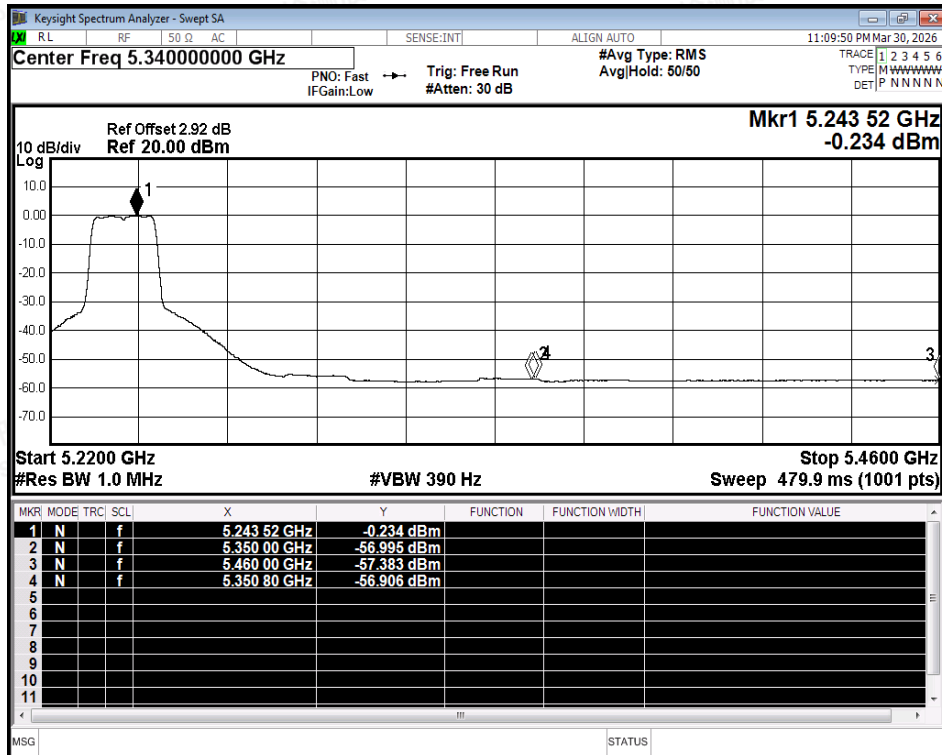

Restrict Band NVNT a 5240MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

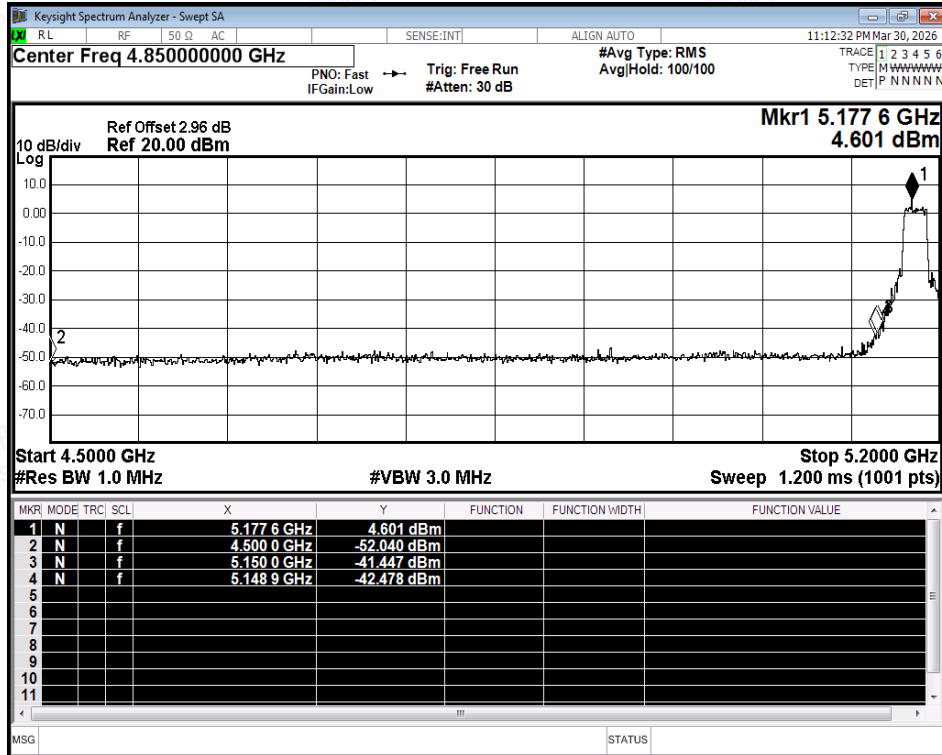

Restrict Band NVNT n20 5180MHz Ant2 Peak

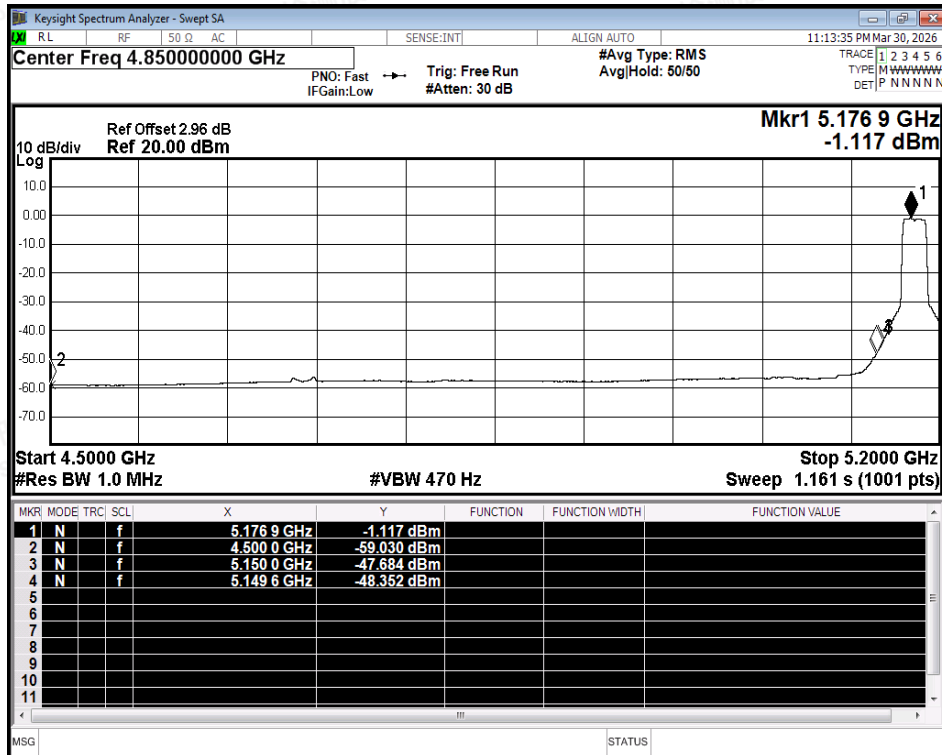

Restrict Band NVNT n20 5180MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

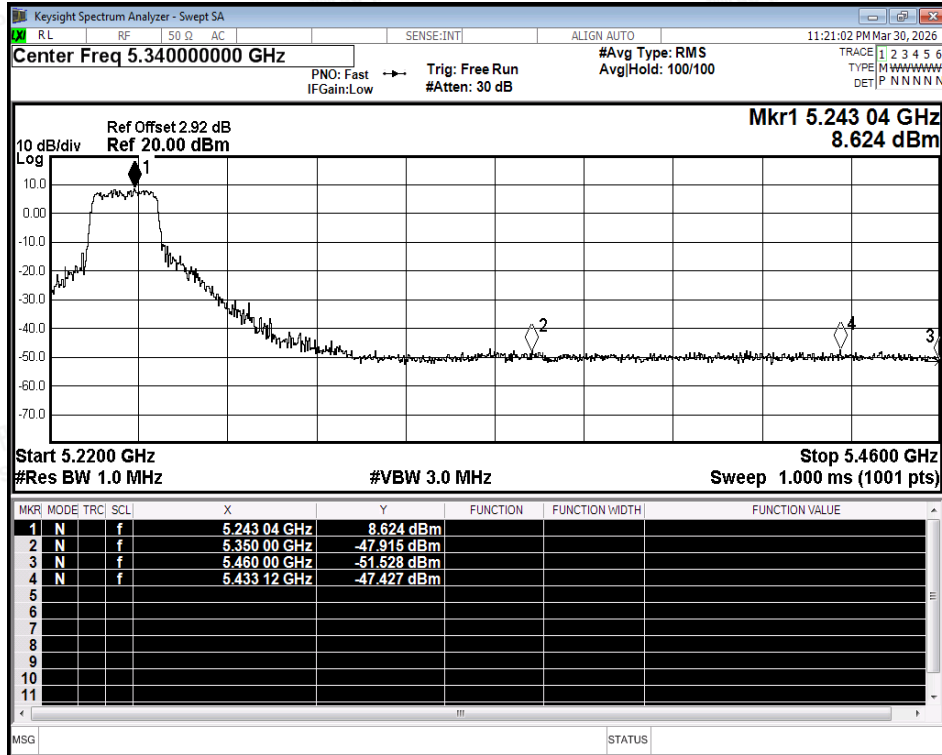

Restrict Band NVNT n20 5240MHz Ant2 Peak

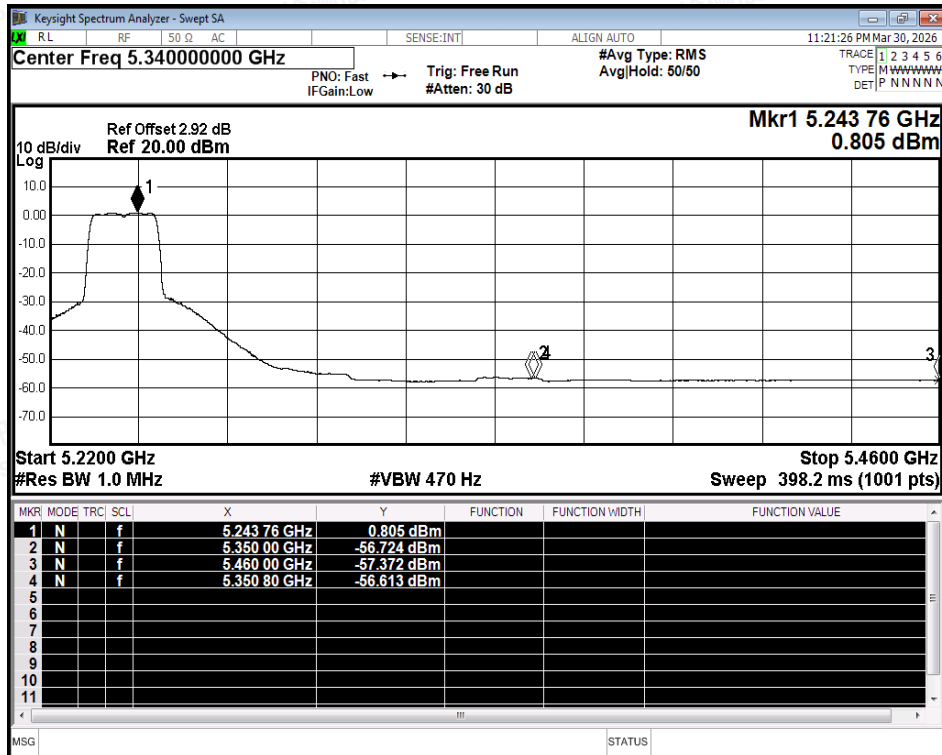

Restrict Band NVNT n20 5240MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

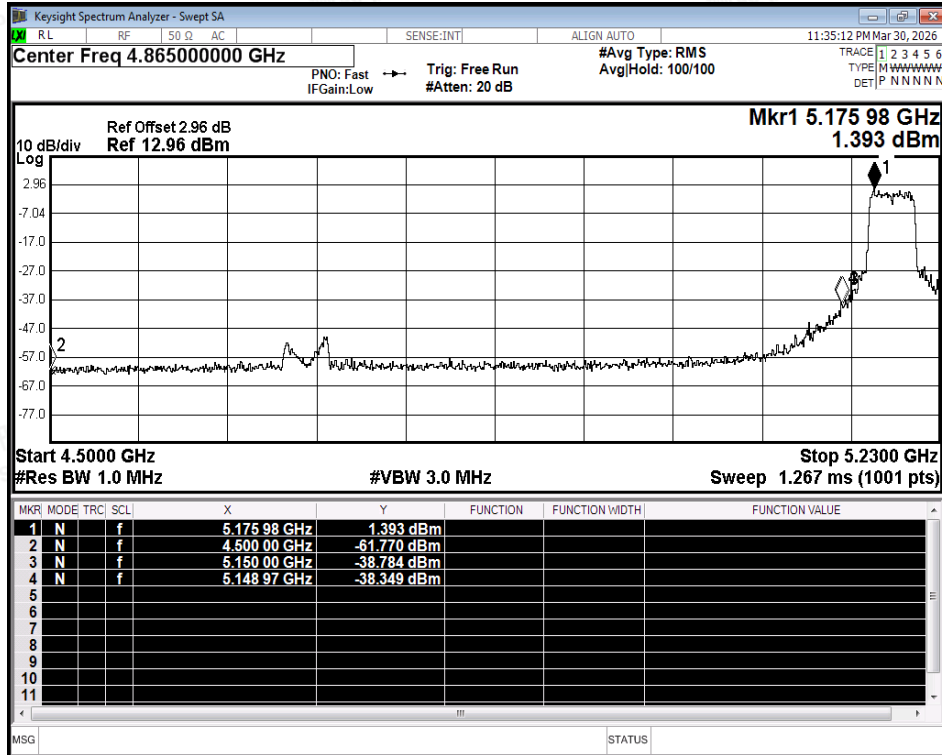

Restrict Band NVNT n40 5190MHz Ant2 Peak

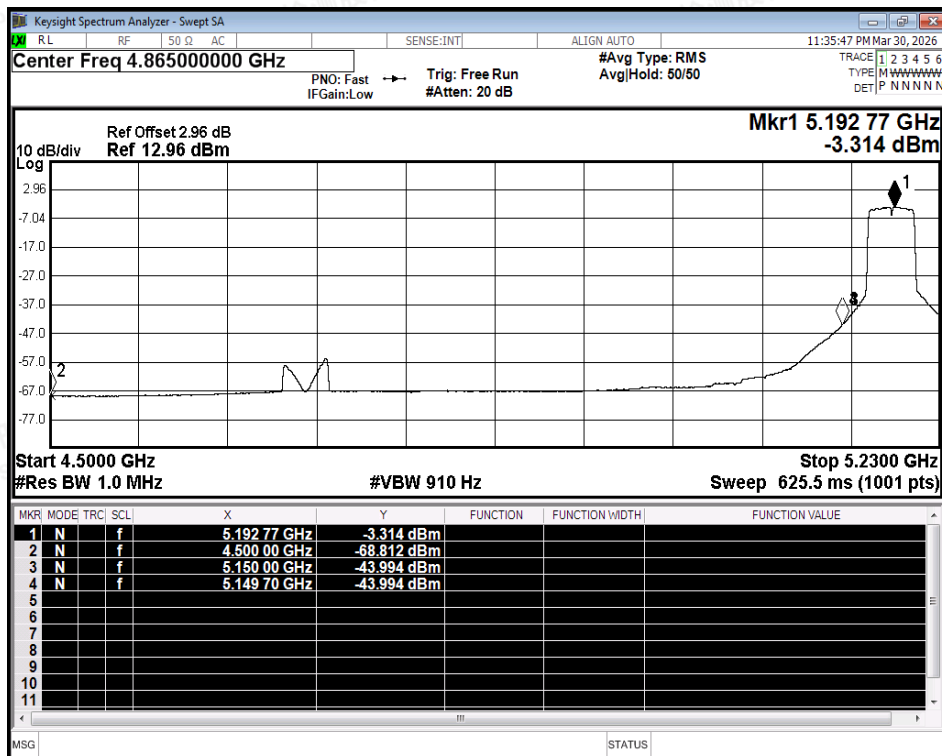

Restrict Band NVNT n40 5190MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

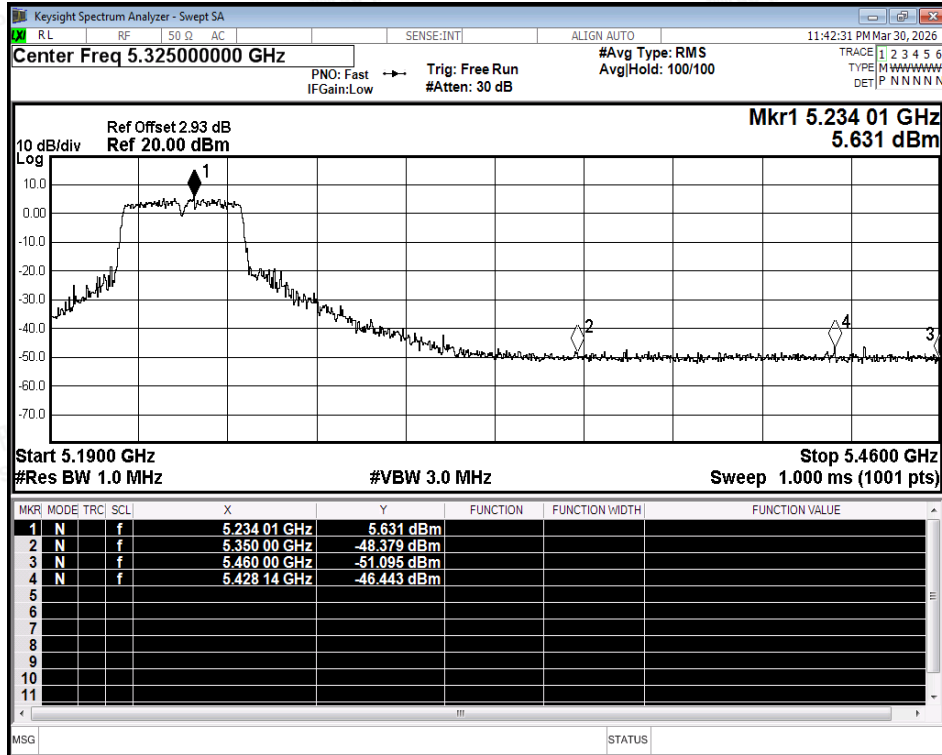

Restrict Band NVNT n40 5230MHz Ant2 Peak

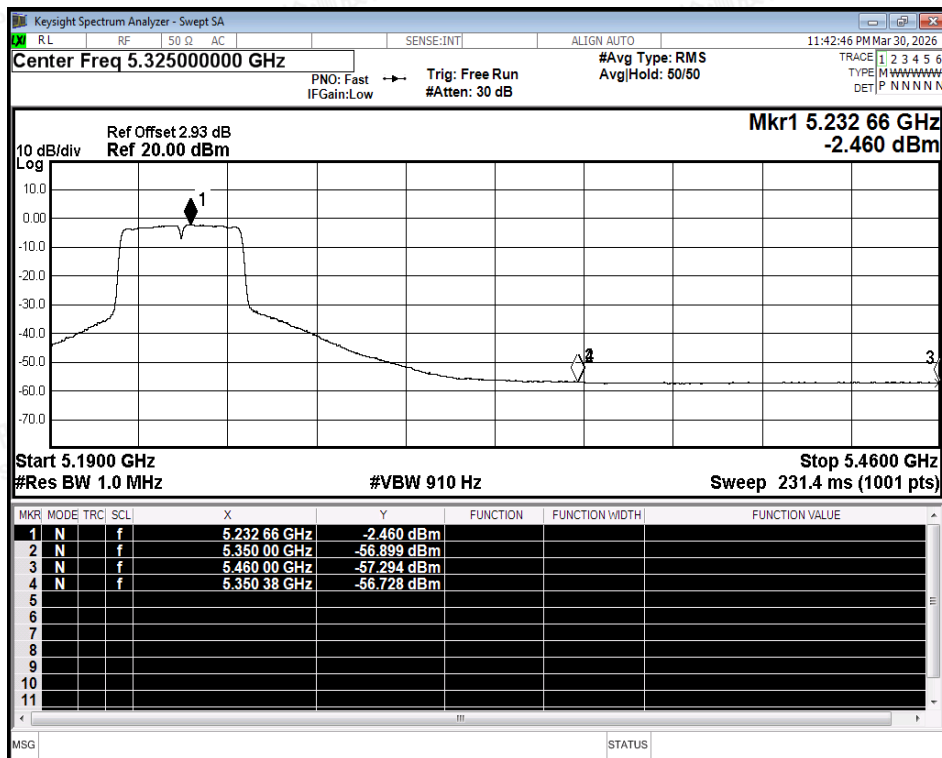

Restrict Band NVNT n40 5230MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

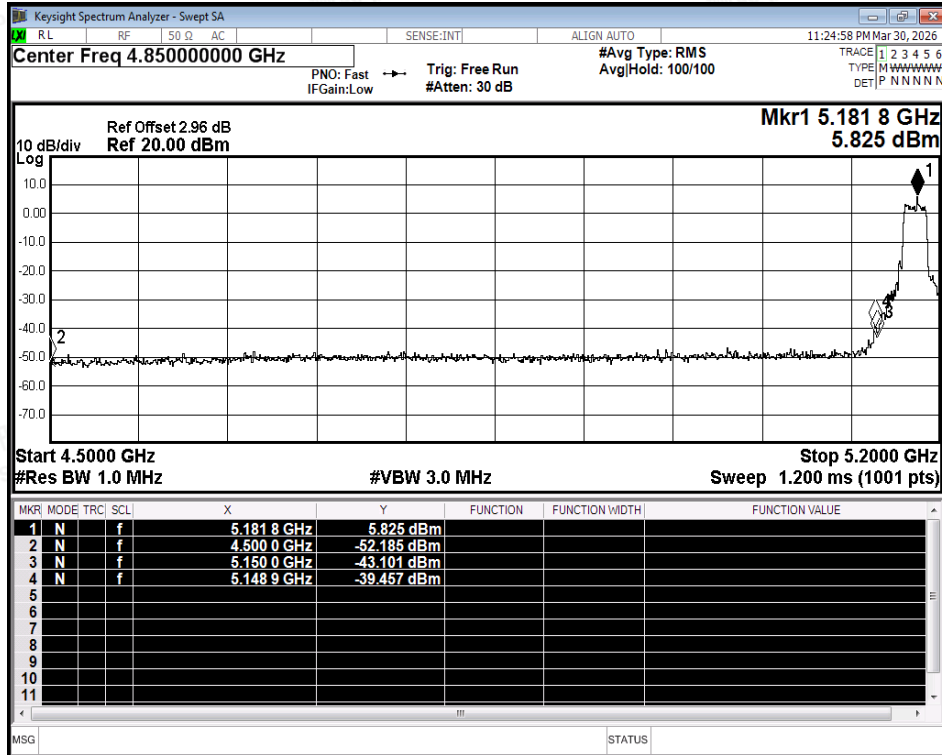

Restrict Band NVNT ac20 5180MHz Ant2 Peak

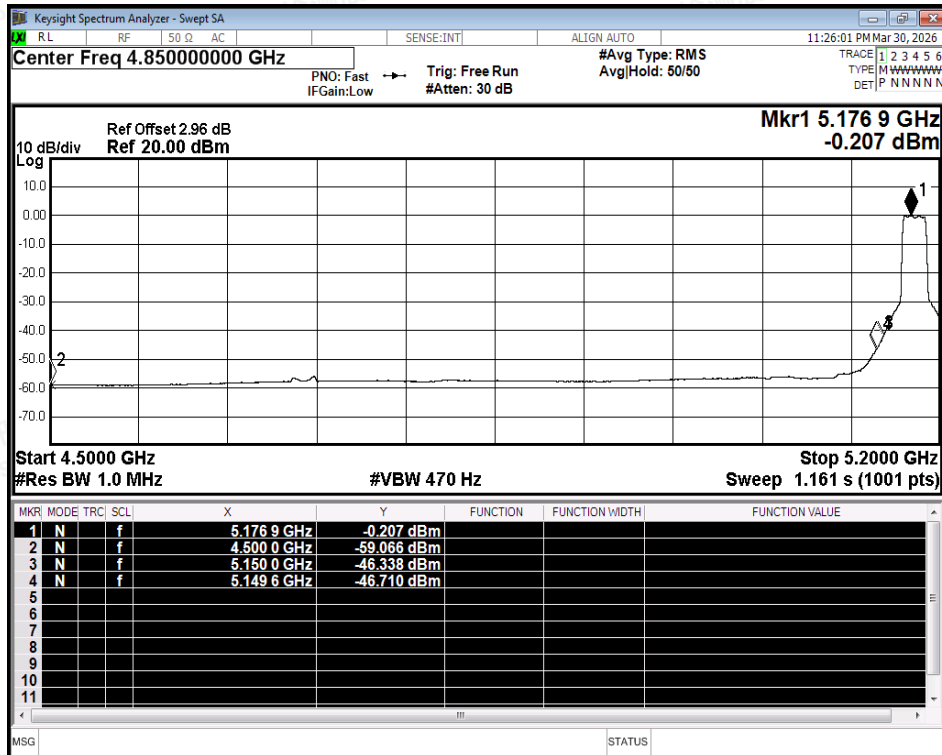

Restrict Band NVNT ac20 5180MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

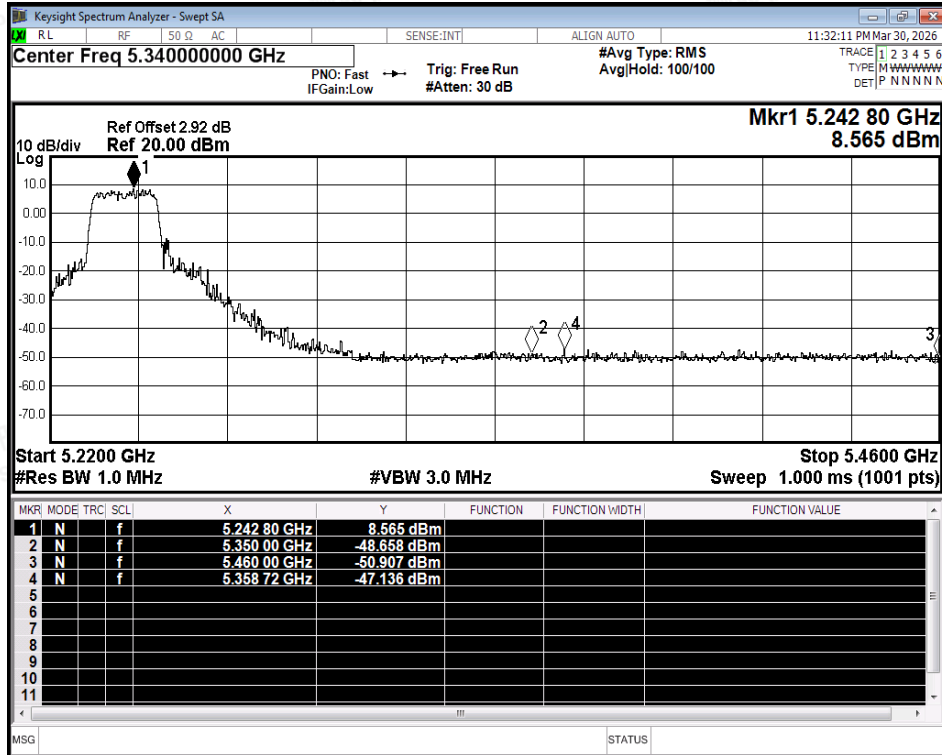

Restrict Band NVNT ac20 5240MHz Ant2 Peak

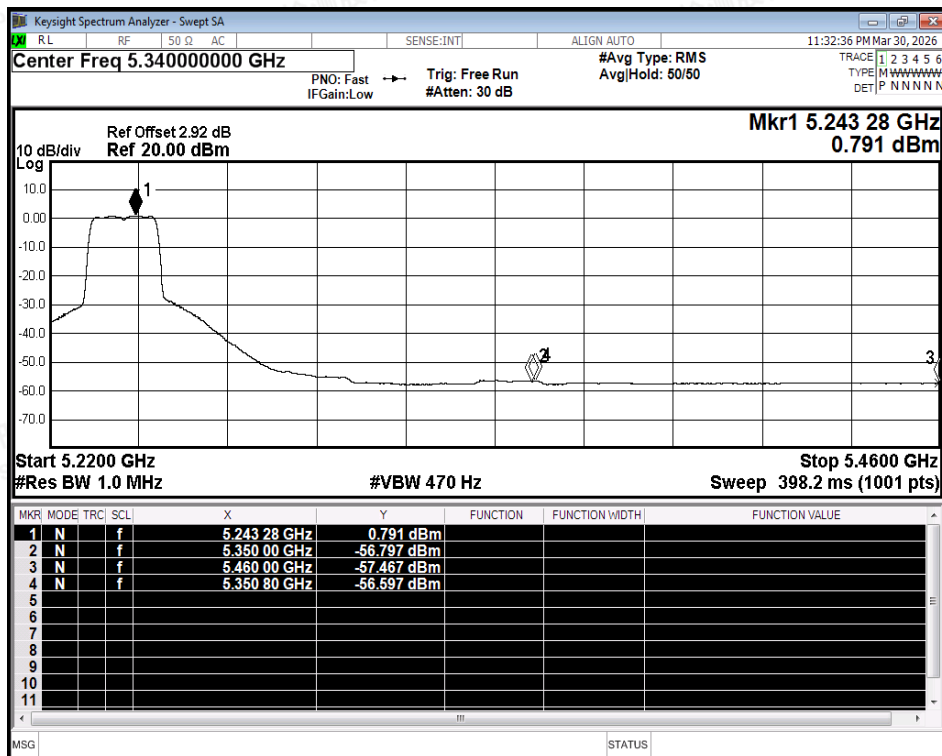

Restrict Band NVNT ac20 5240MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

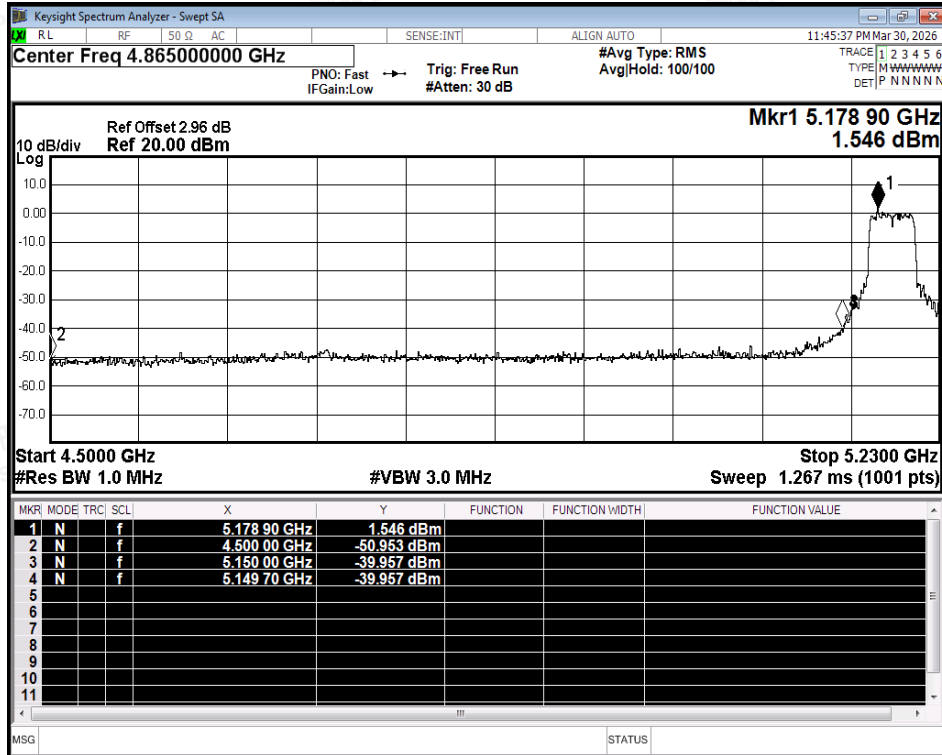

Restrict Band NVNT ac40 5190MHz Ant2 Peak

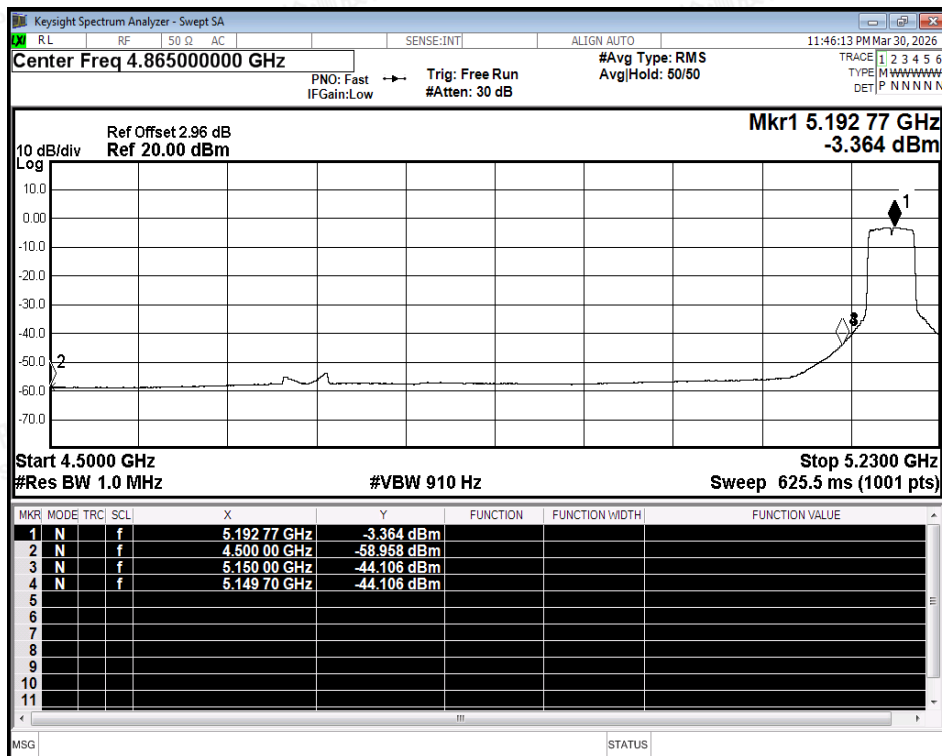

Restrict Band NVNT ac40 5190MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

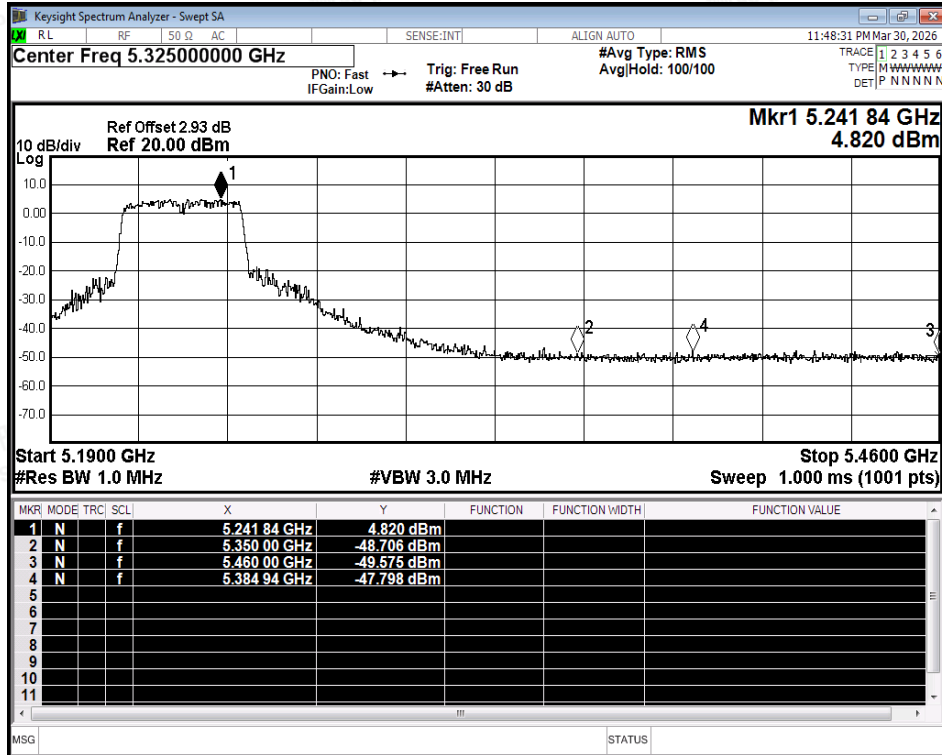

Restrict Band NVNT ac40 5230MHz Ant2 Peak

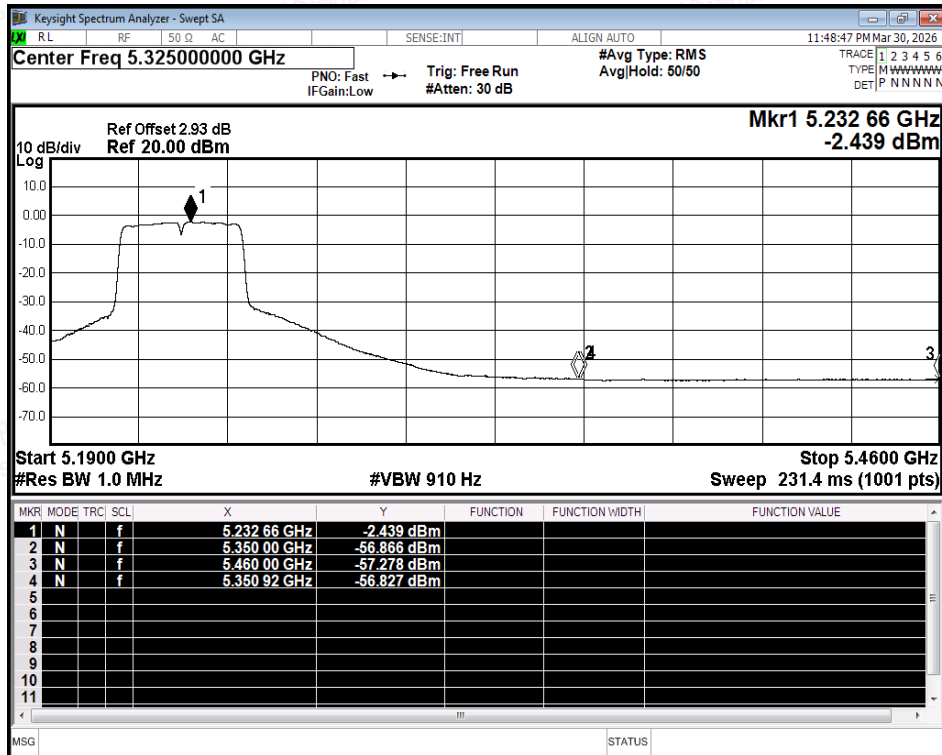

Restrict Band NVNT ac40 5230MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

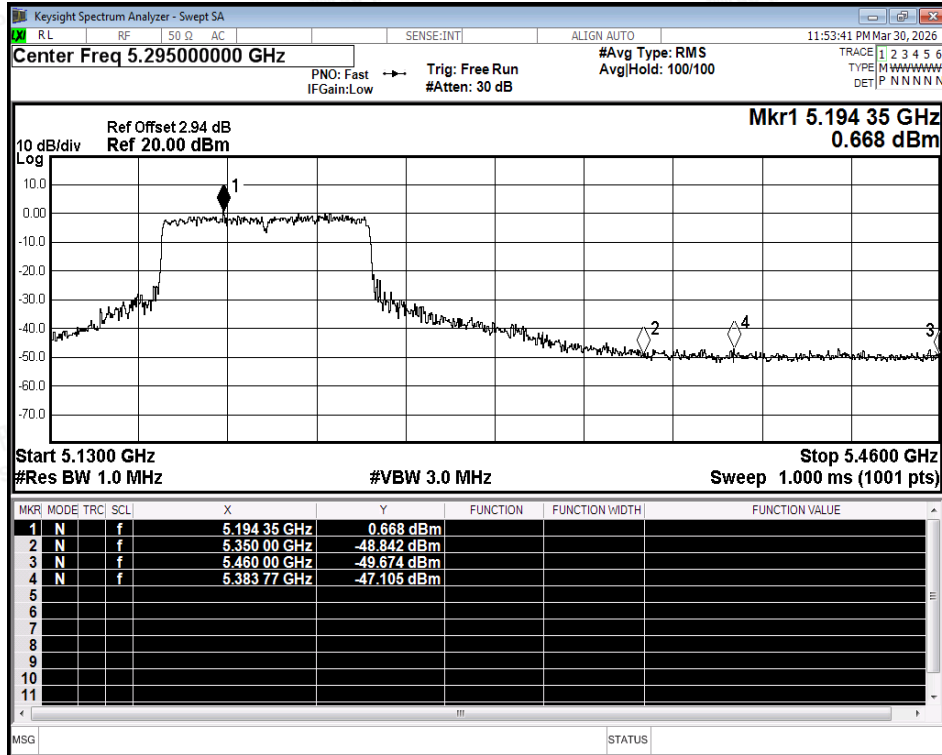

Restrict Band NVNT ac80 5210MHz Ant2 Peak

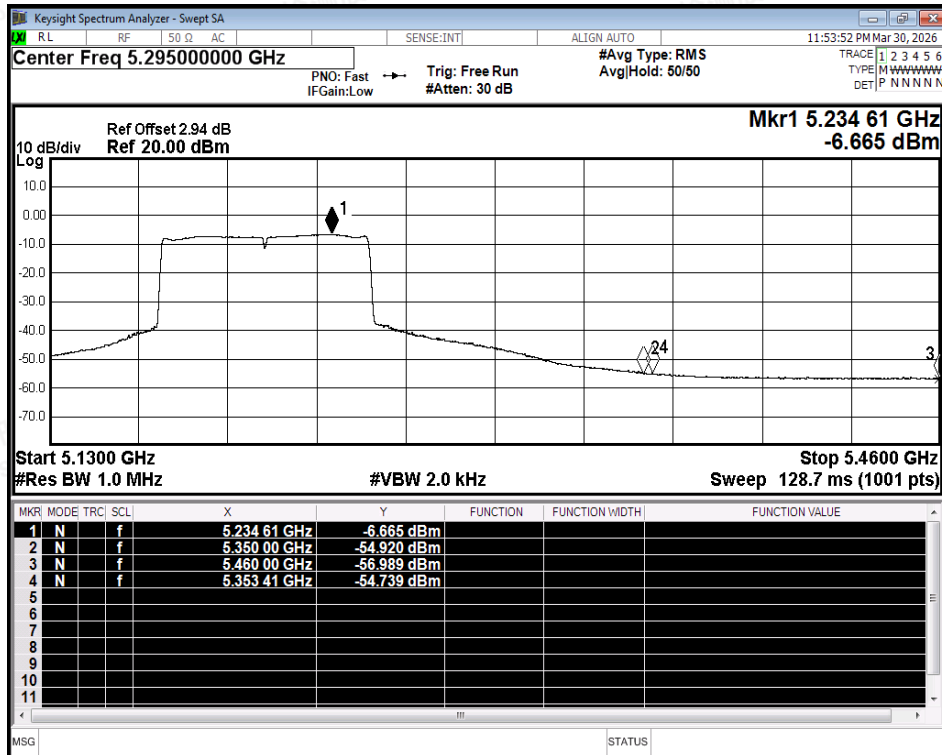

Restrict Band NVNT ac80 5210MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

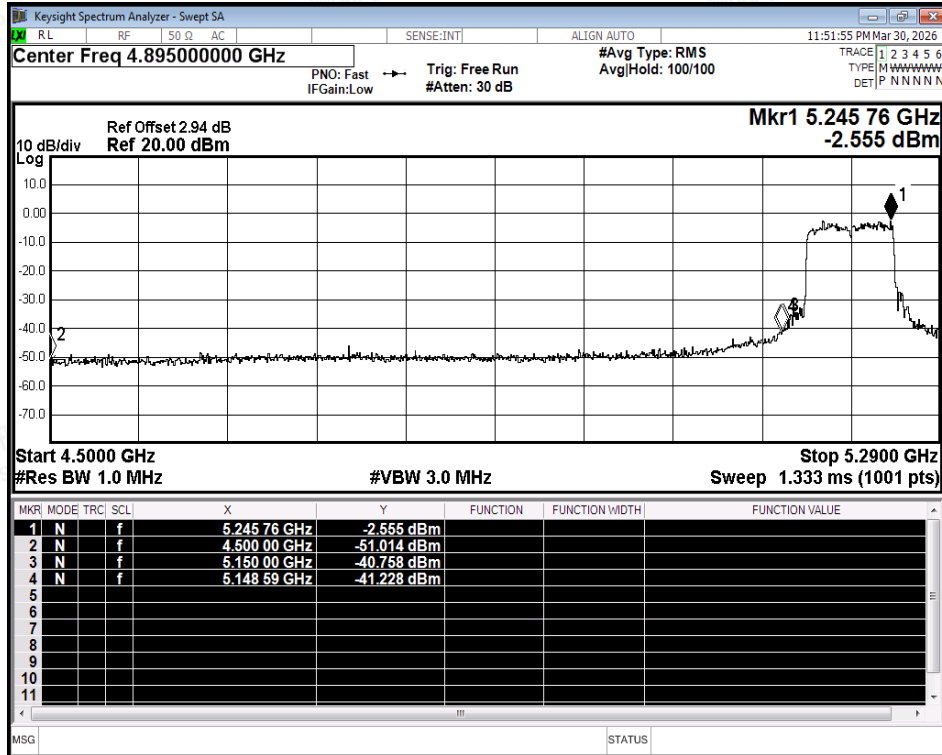

Restrict Band NVNT ac80 5210MHz Ant2 Peak

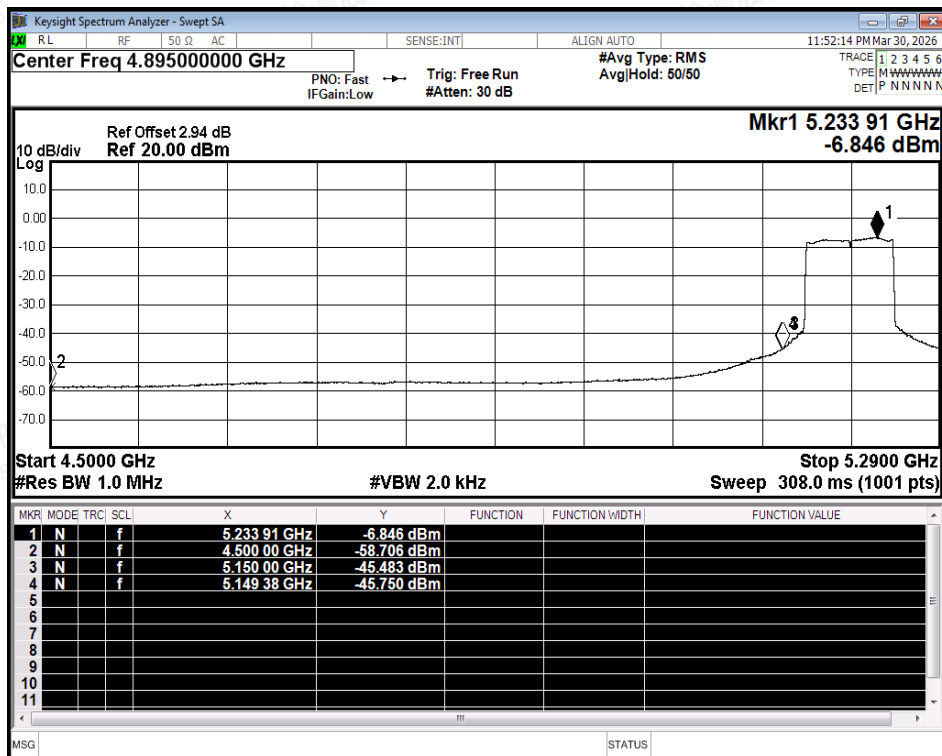

Restrict Band NVNT ac80 5210MHz Ant2 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant2	5180	0	0	25	Pass
NVNT	a	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	n20	5180	Ant2	5179.96	-40000	-7.72	25	Pass
NVNT	n20	5200	Ant2	5200	0	0	25	Pass
NVNT	n20	5240	Ant2	5240	0	0	25	Pass
NVNT	n40	5190	Ant2	5190	0	0	25	Pass
NVNT	n40	5230	Ant2	5230	0	0	25	Pass
NVNT	ac20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant2	5199.96	-40000	-7.69	25	Pass
NVNT	ac20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant2	5190	0	0	25	Pass
NVNT	ac40	5230	Ant2	5230	0	0	25	Pass
NVNT	ac80	5210	Ant2	5210	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

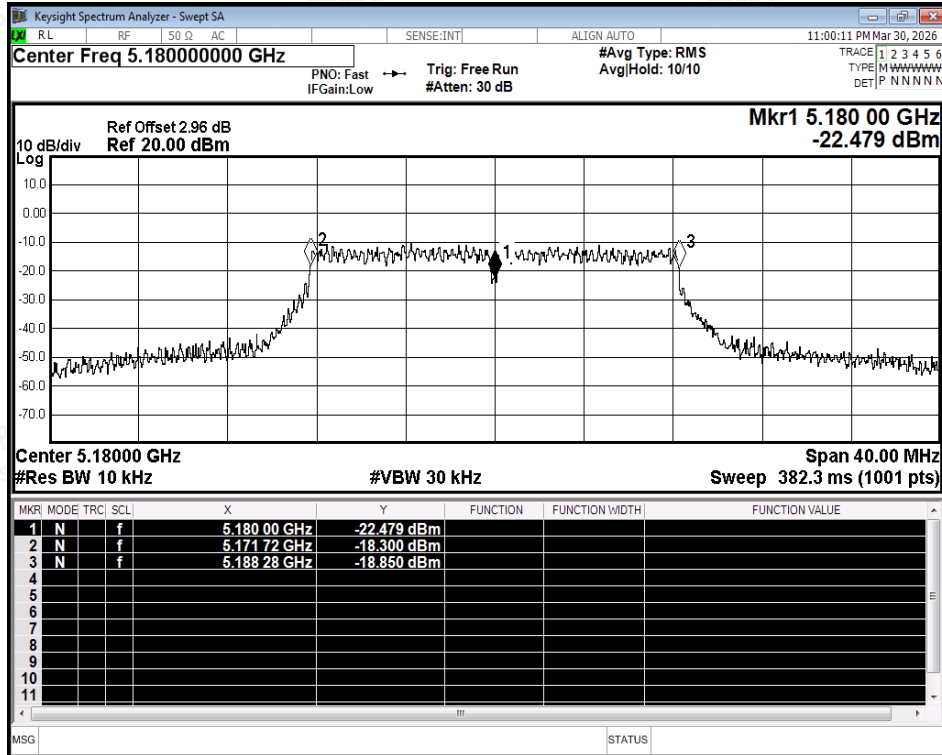

Freq. Stability NVNT a 5180MHz Ant2

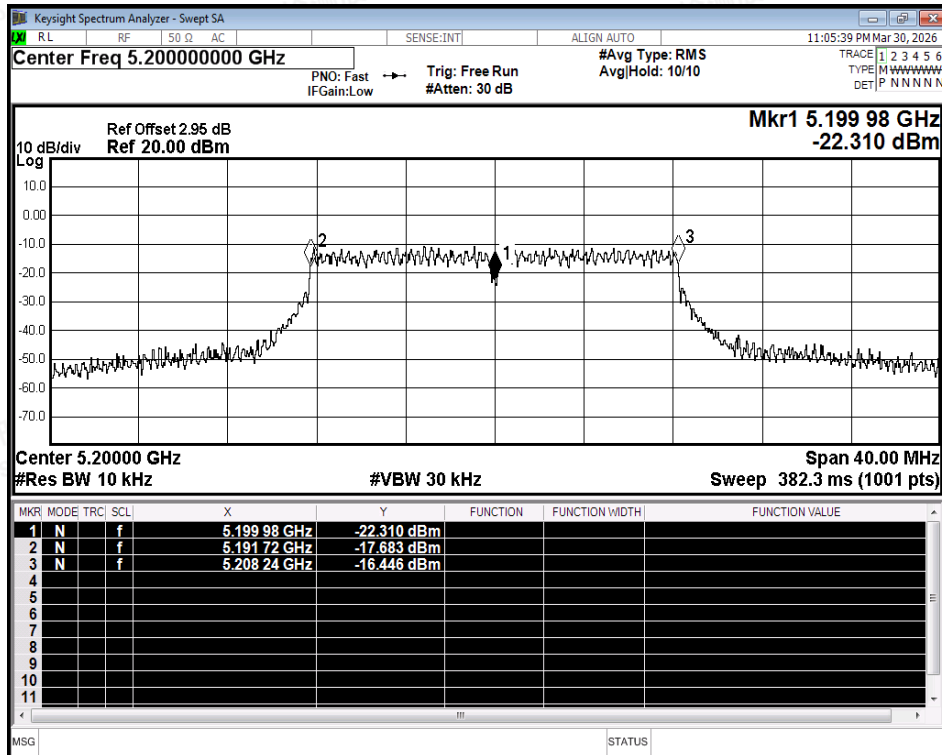

Freq. Stability NVNT a 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

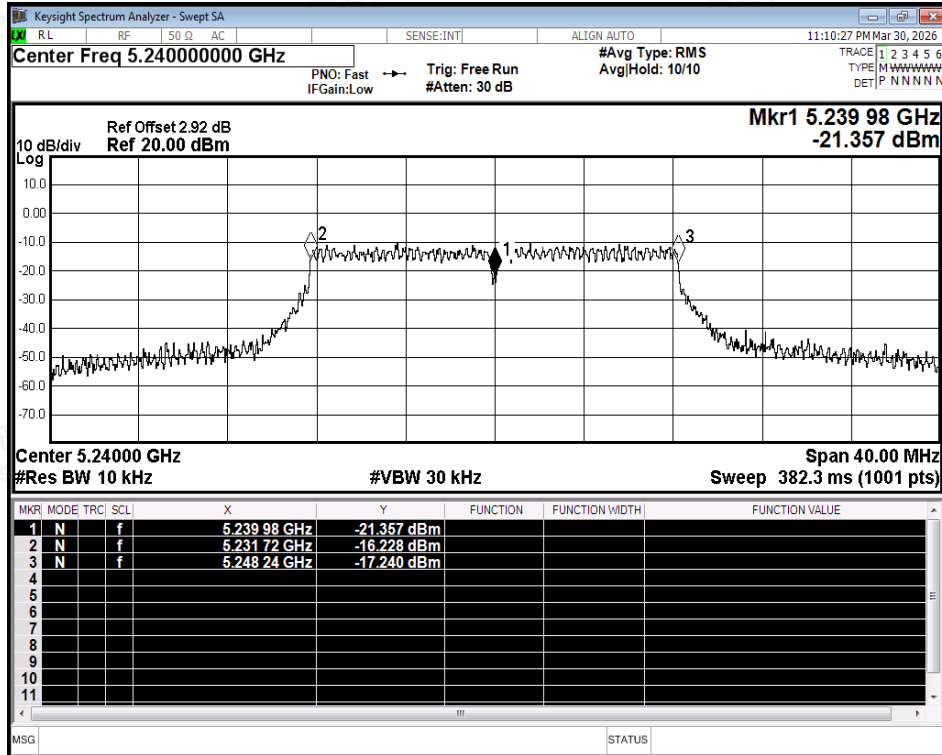

Freq. Stability NVNT a 5240MHz Ant2

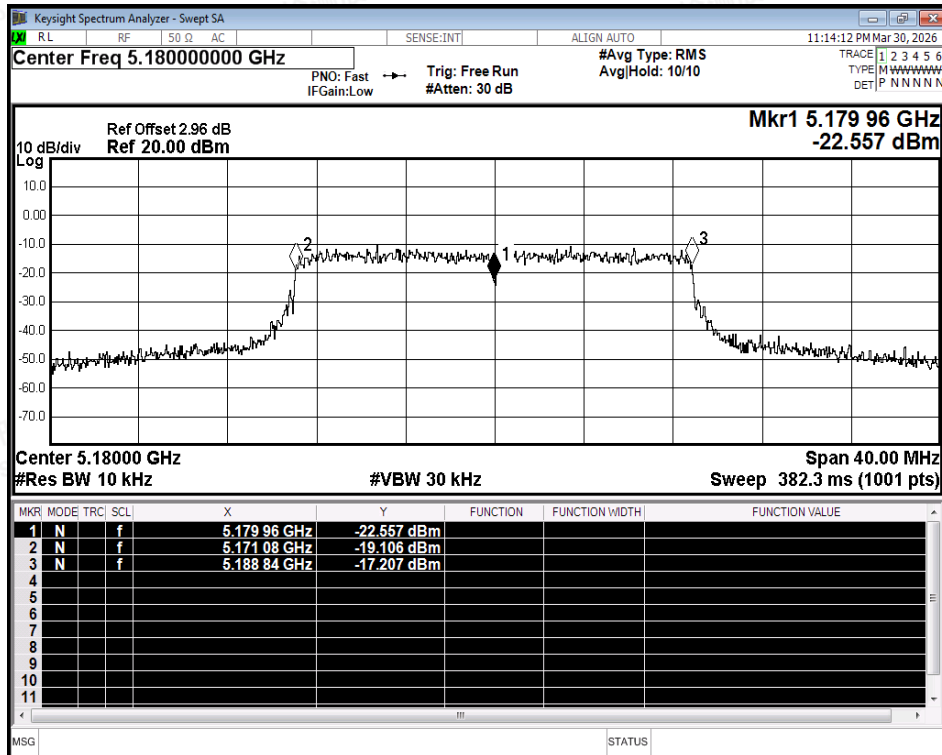

Freq. Stability NVNT n20 5180MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

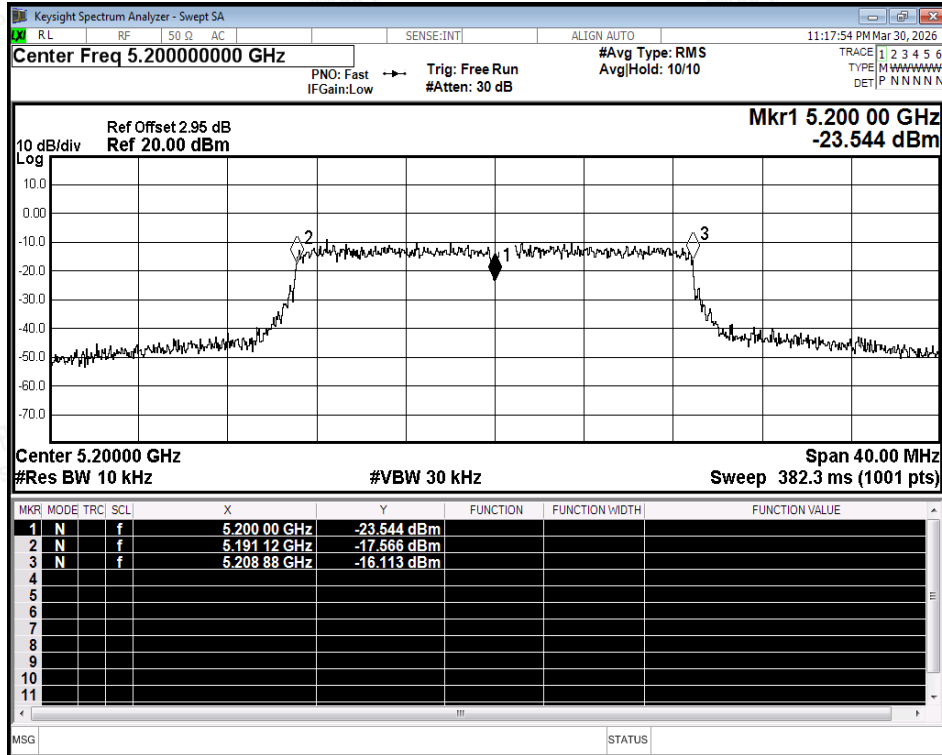

Freq. Stability NVNT n20 5200MHz Ant2

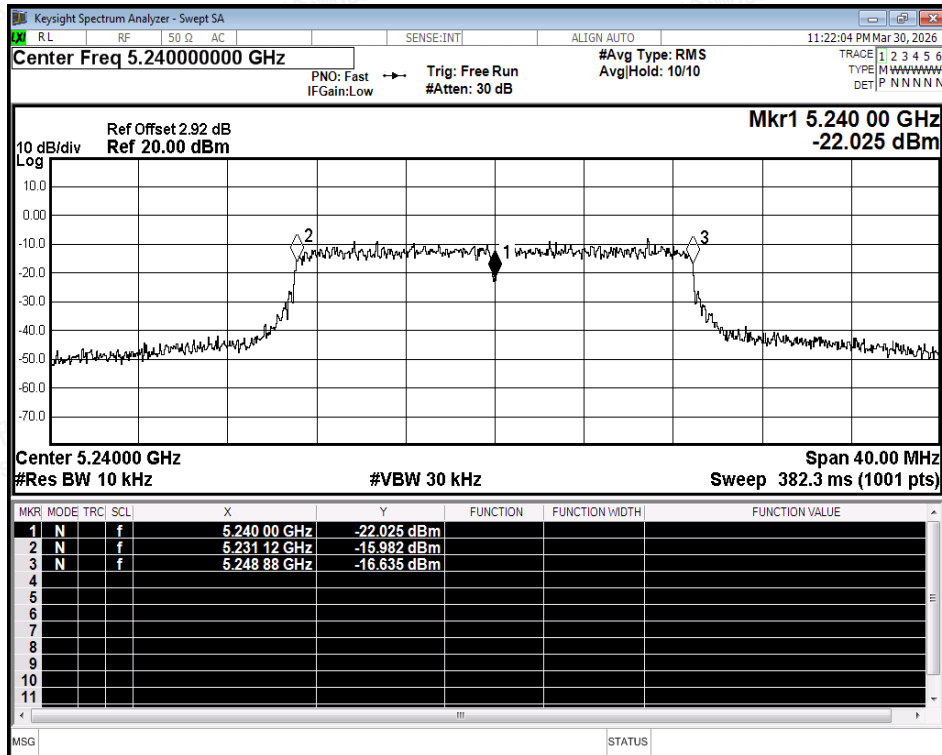

Freq. Stability NVNT n20 5240MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

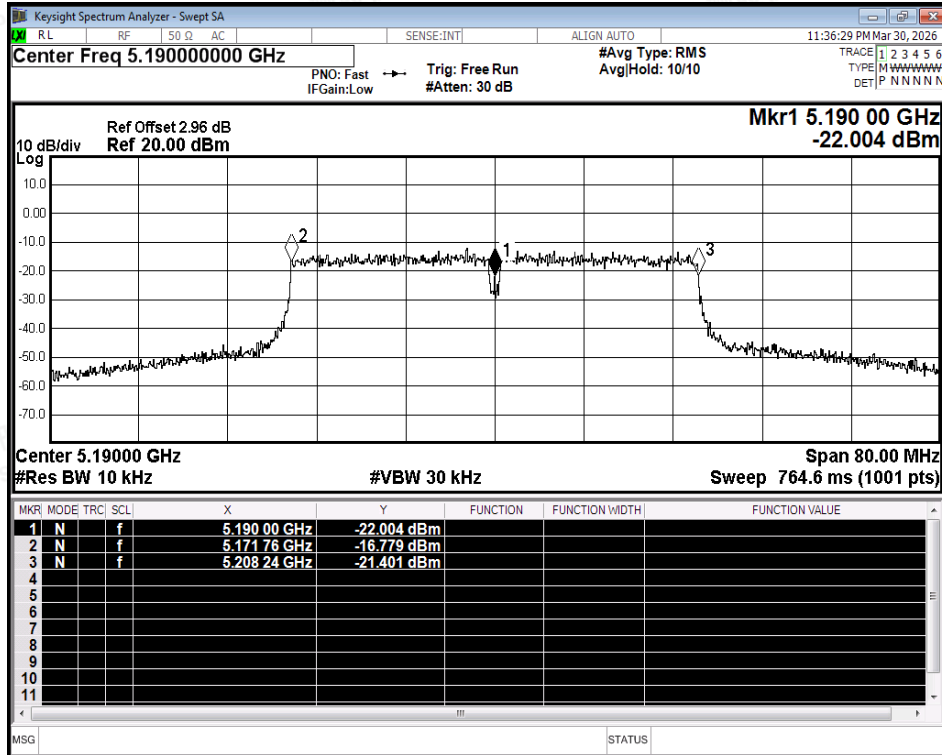

Freq. Stability NVNT n40 5190MHz Ant2

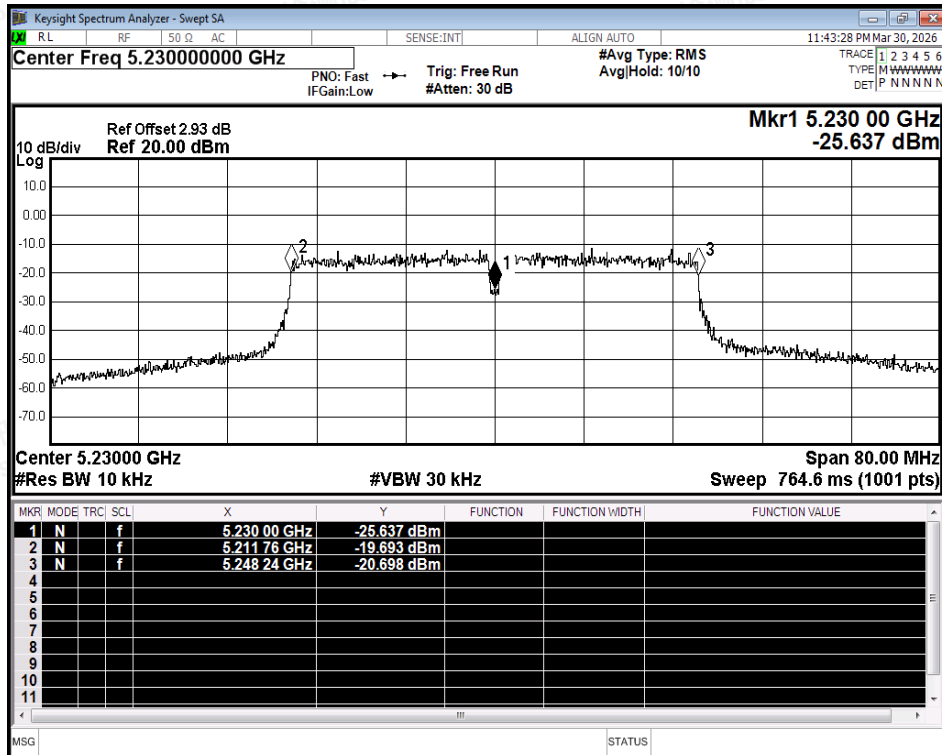

Freq. Stability NVNT n40 5230MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

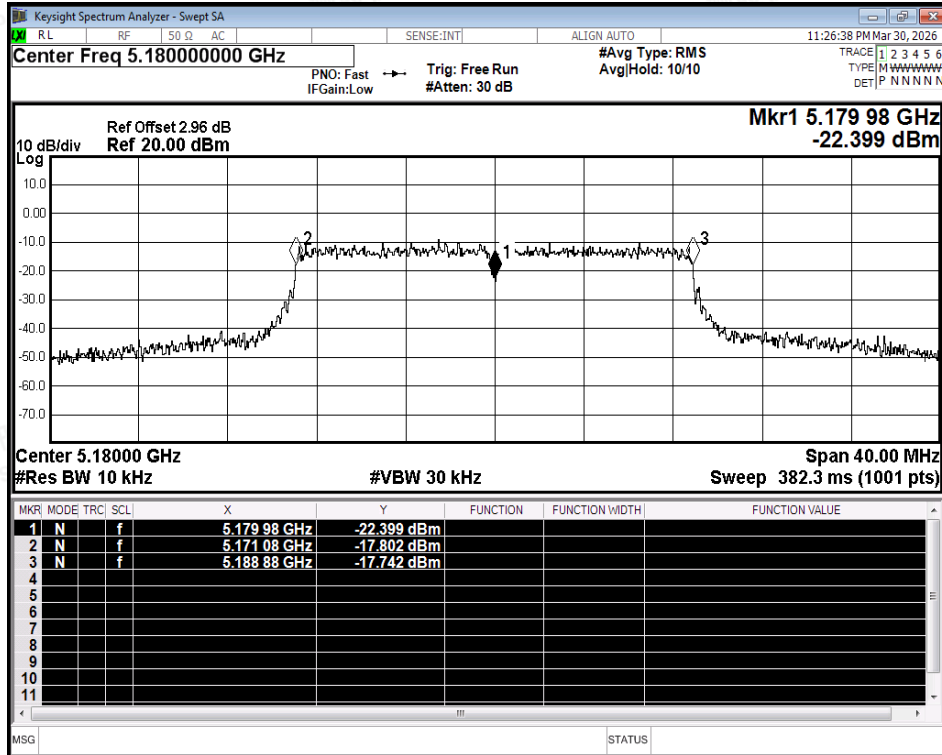

Freq. Stability NVNT ac20 5180MHz Ant2

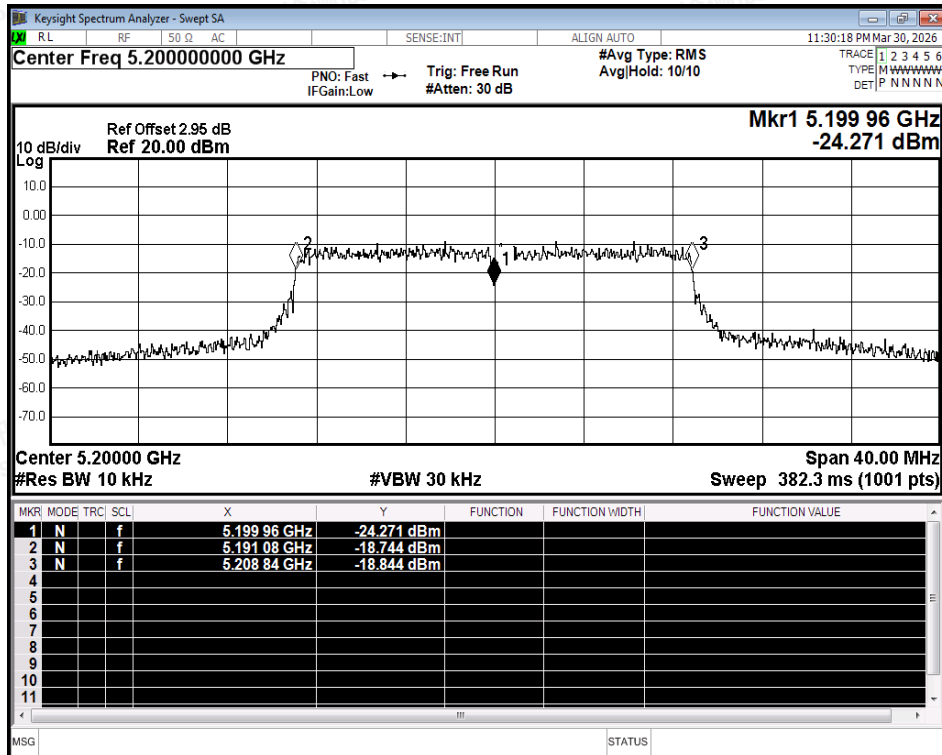

Freq. Stability NVNT ac20 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

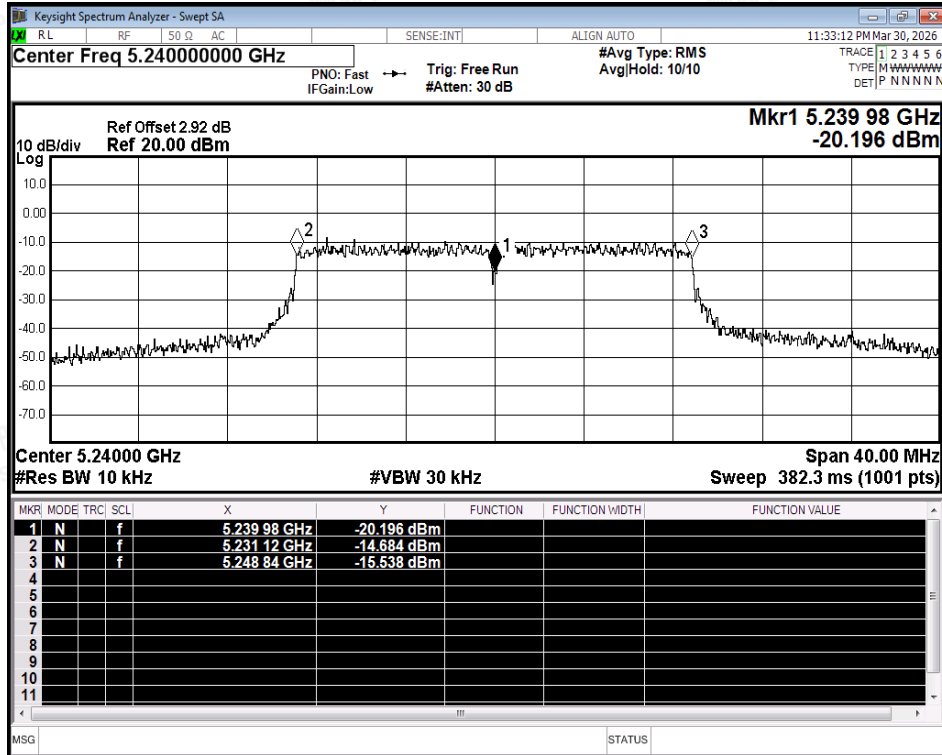

Freq. Stability NVNT ac20 5240MHz Ant2

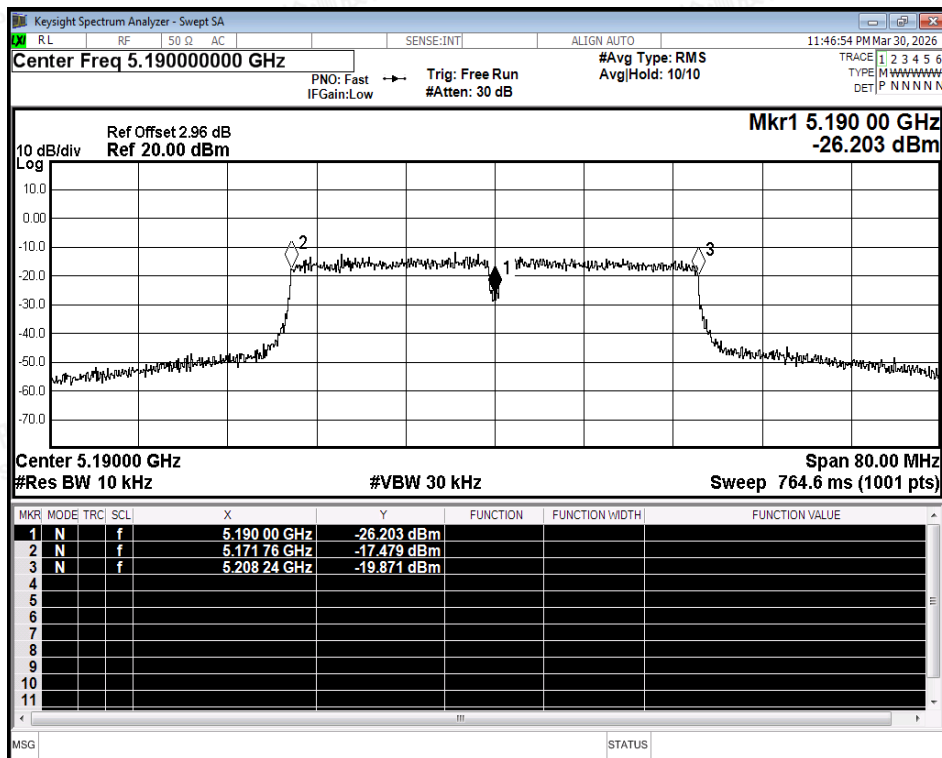

Freq. Stability NVNT ac40 5190MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

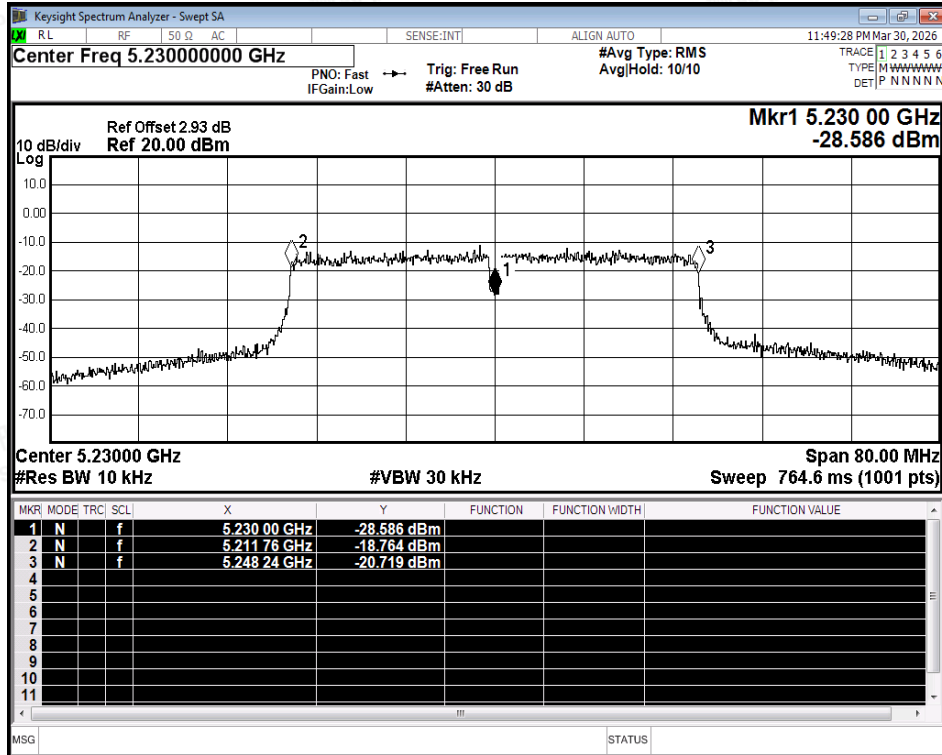

Freq. Stability NVNT ac40 5230MHz Ant2

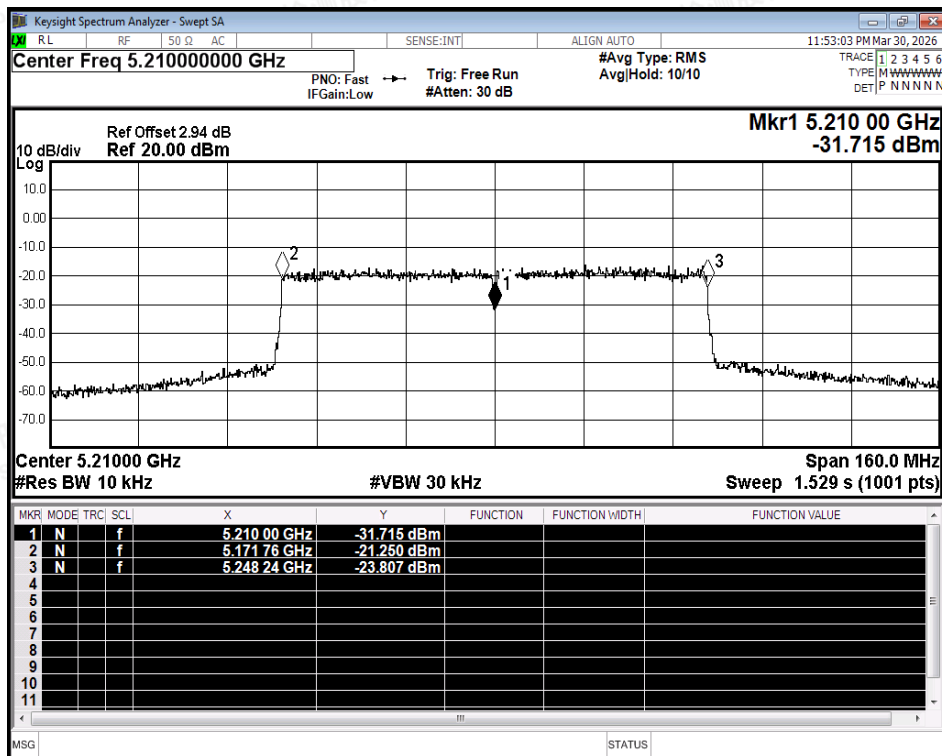

Freq. Stability NVNT ac80 5210MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




D.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant2	97.83	0.1	0.37
NVNT	a	5200	Ant2	97.83	0.1	0.37
NVNT	a	5240	Ant2	97.46	0.11	0.37
NVNT	n20	5180	Ant2	97.41	0.11	0.44
NVNT	n20	5200	Ant2	97	0.13	0.44
NVNT	n20	5240	Ant2	97	0.13	0.44
NVNT	n40	5190	Ant2	94.87	0.23	0.9
NVNT	n40	5230	Ant2	94.87	0.23	0.9
NVNT	ac20	5180	Ant2	97	0.13	0.44
NVNT	ac20	5200	Ant2	97.42	0.11	0.44
NVNT	ac20	5240	Ant2	97.42	0.11	0.44
NVNT	ac40	5190	Ant2	94.92	0.23	0.89
NVNT	ac40	5230	Ant2	94.07	0.27	0.9
NVNT	ac80	5210	Ant2	90	0.46	1.85



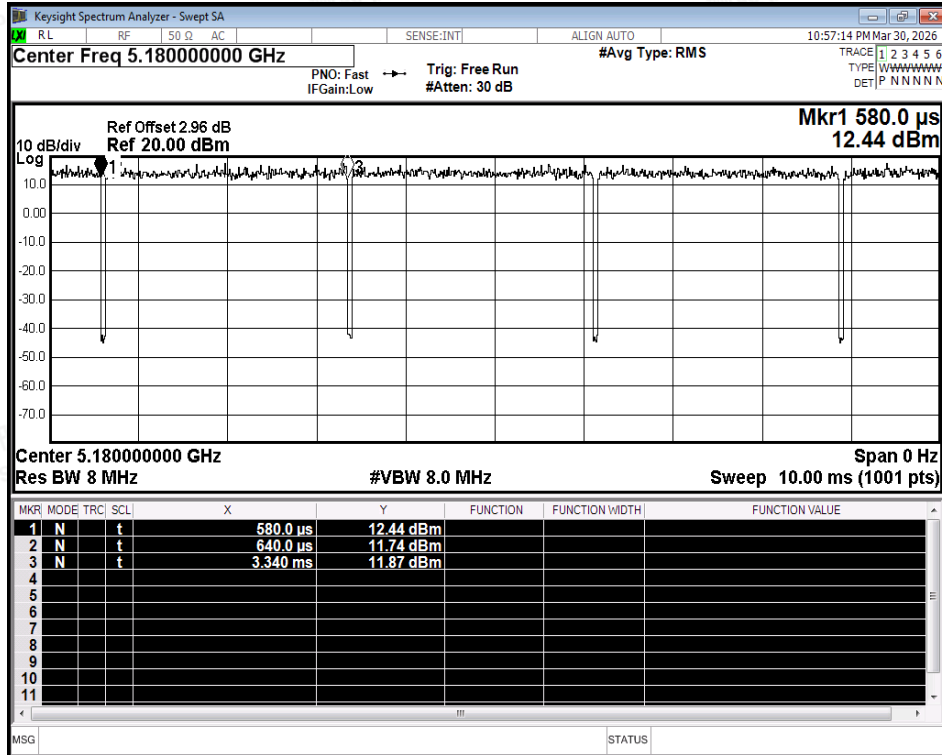

Duty Cycle NVNT a 5180MHz Ant2

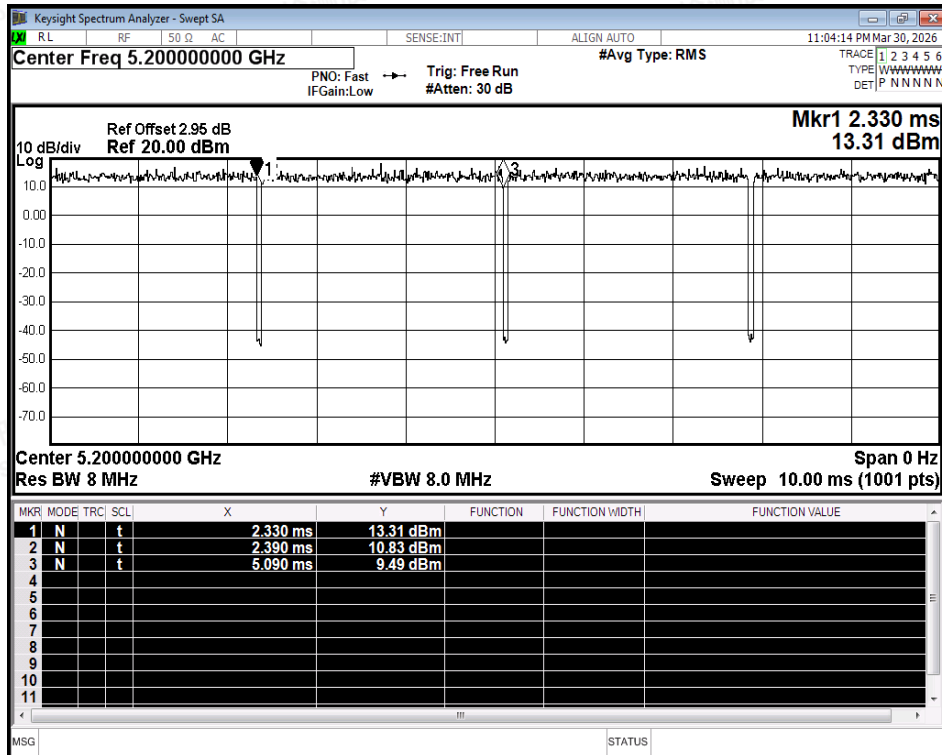

Duty Cycle NVNT a 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

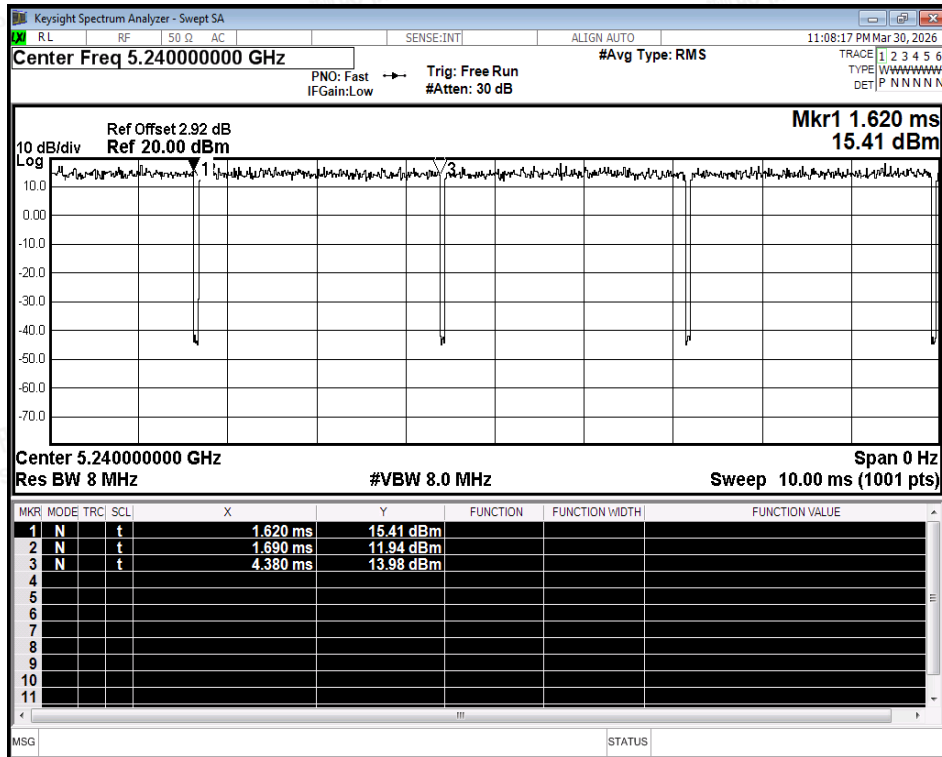

Duty Cycle NVNT a 5240MHz Ant2

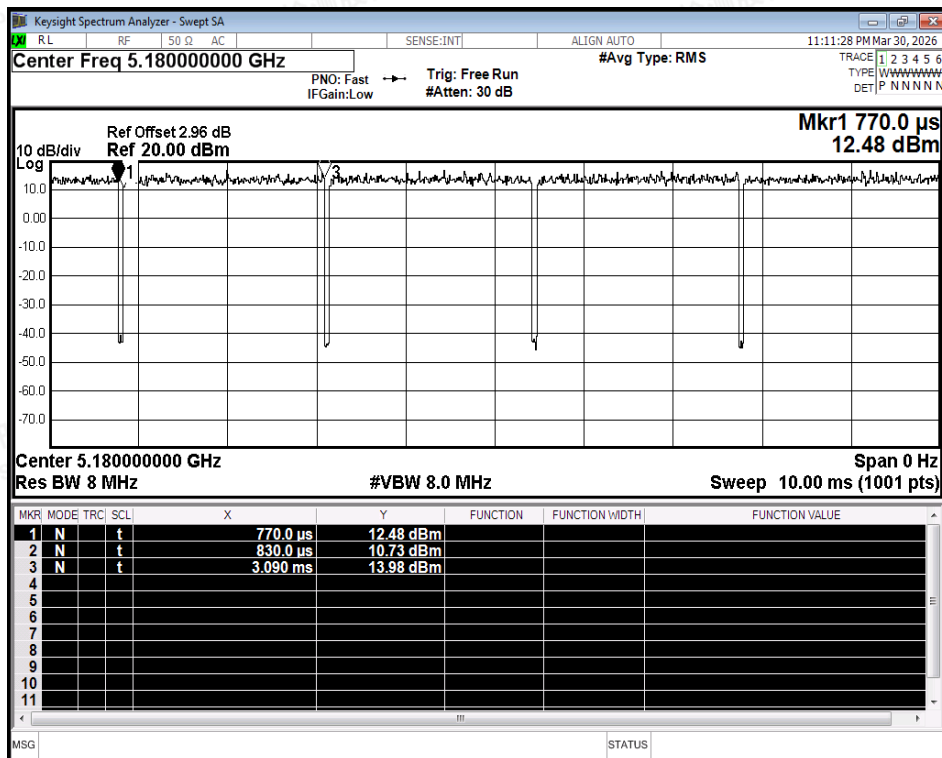

Duty Cycle NVNT n20 5180MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

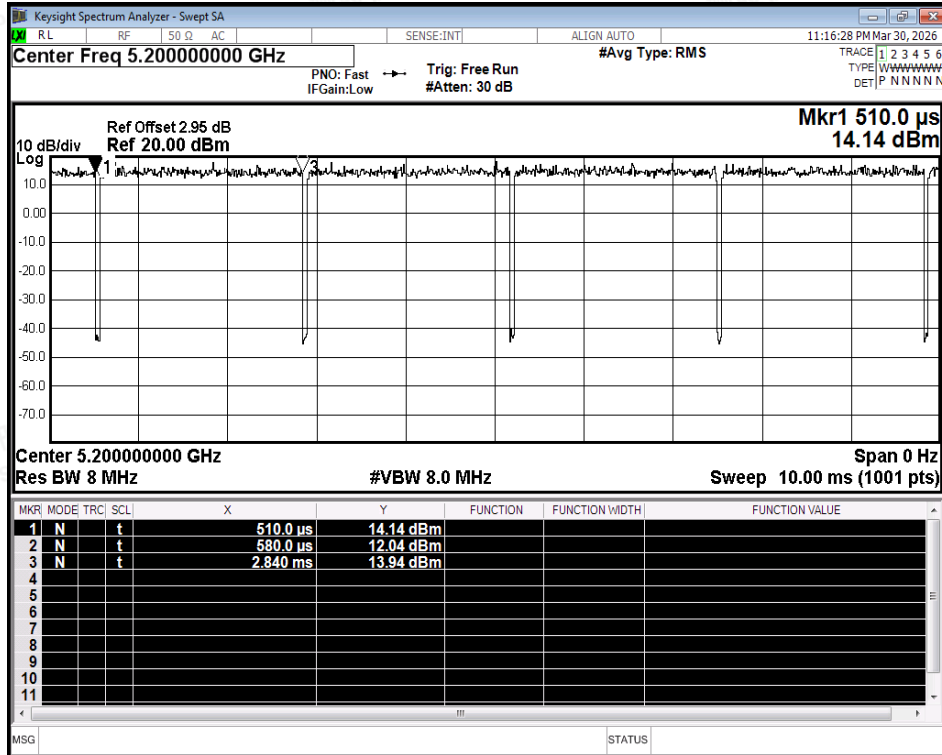

Duty Cycle NVNT n20 5200MHz Ant2

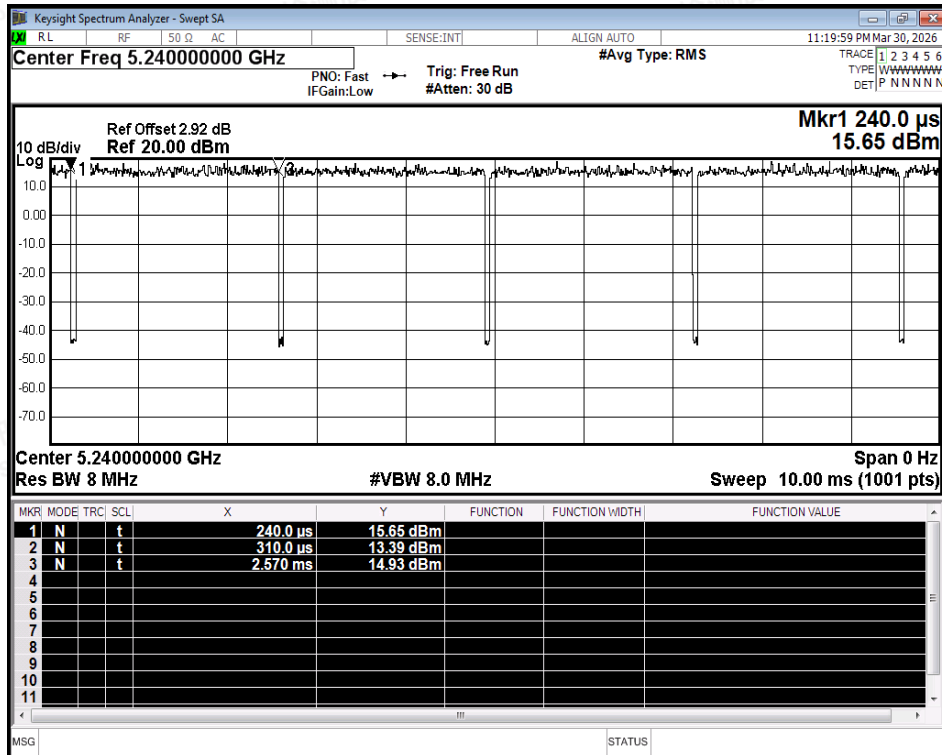

Duty Cycle NVNT n20 5240MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

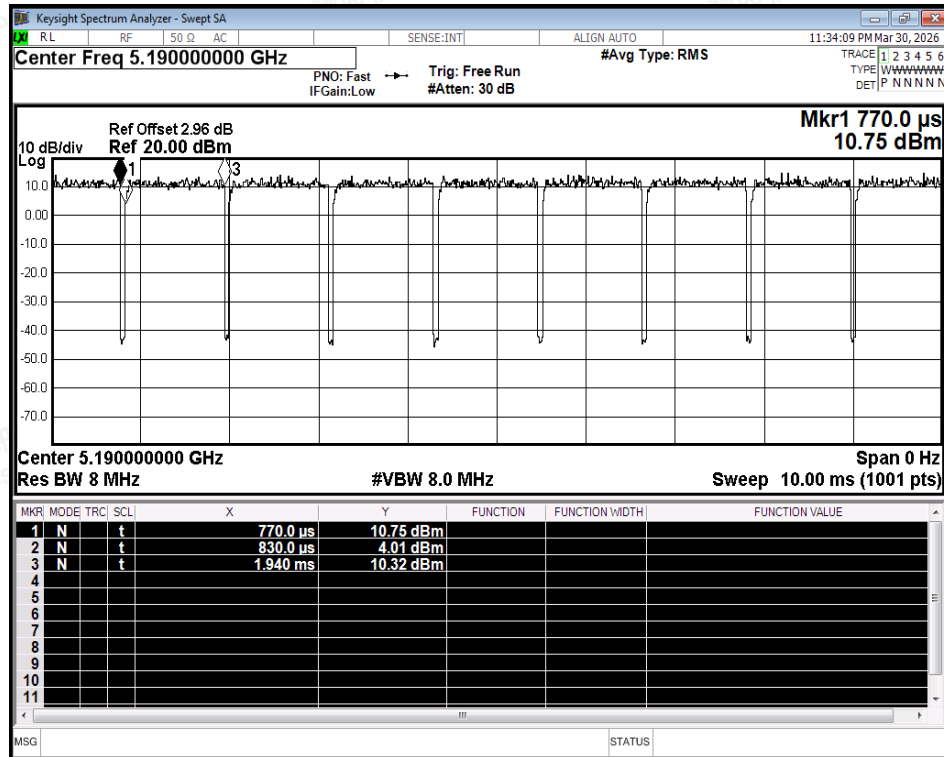

Duty Cycle NVNT n40 5190MHz Ant2

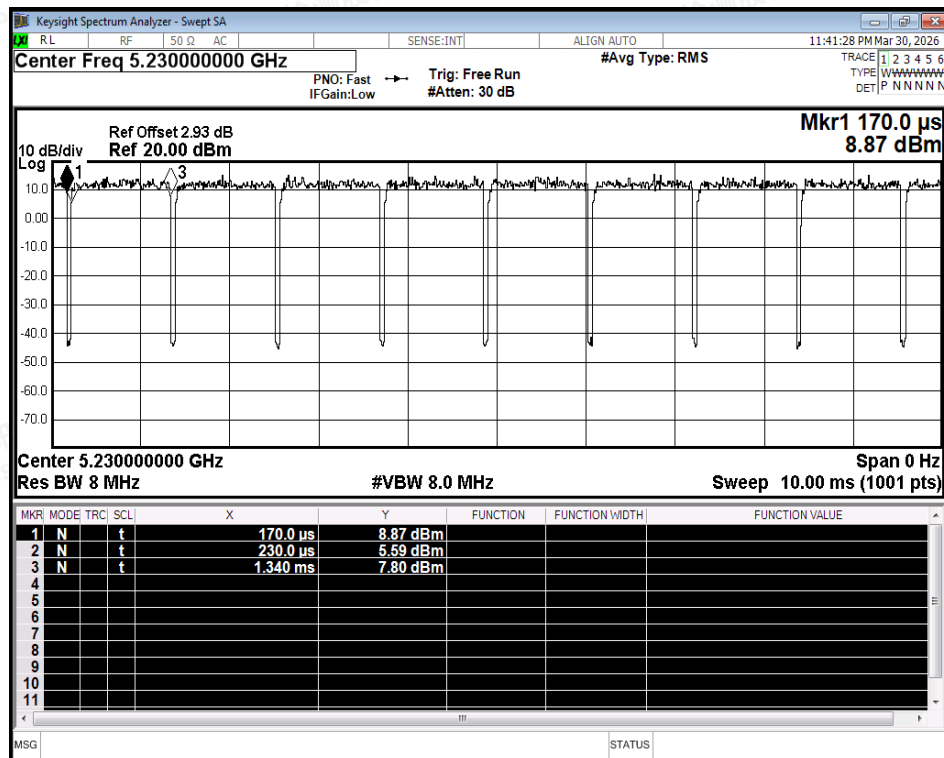

Duty Cycle NVNT n40 5230MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

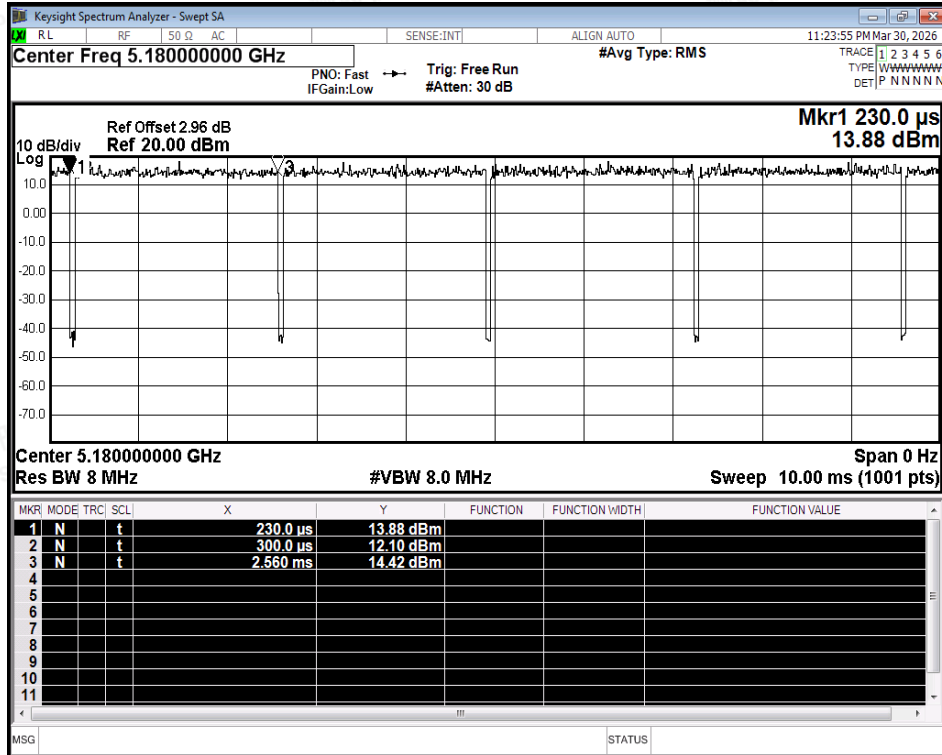

Duty Cycle NVNT ac20 5180MHz Ant2

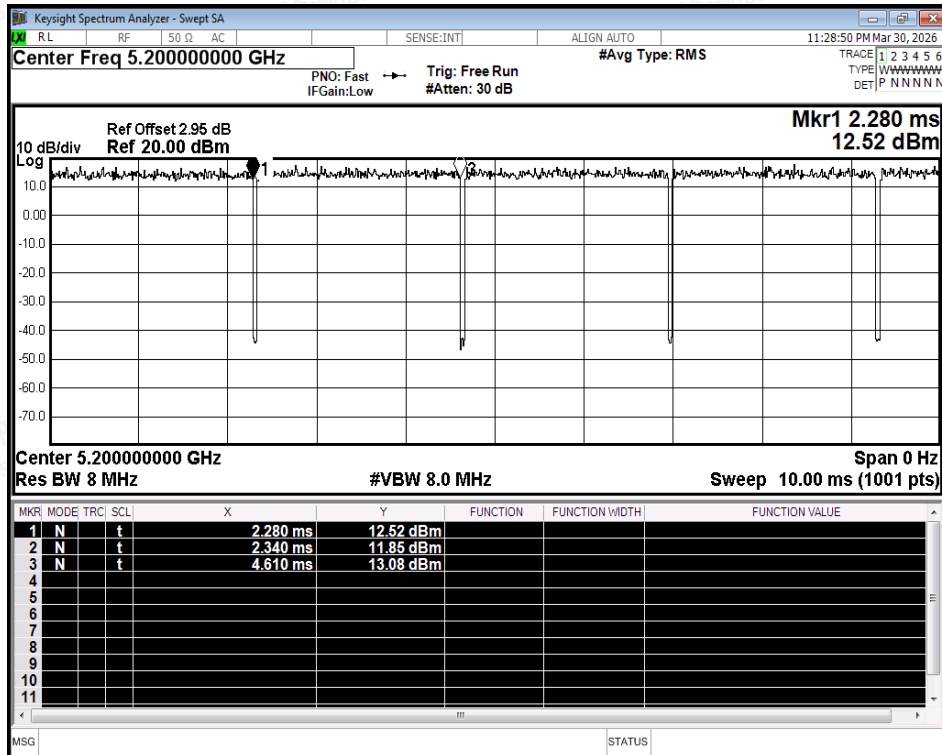

Duty Cycle NVNT ac20 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

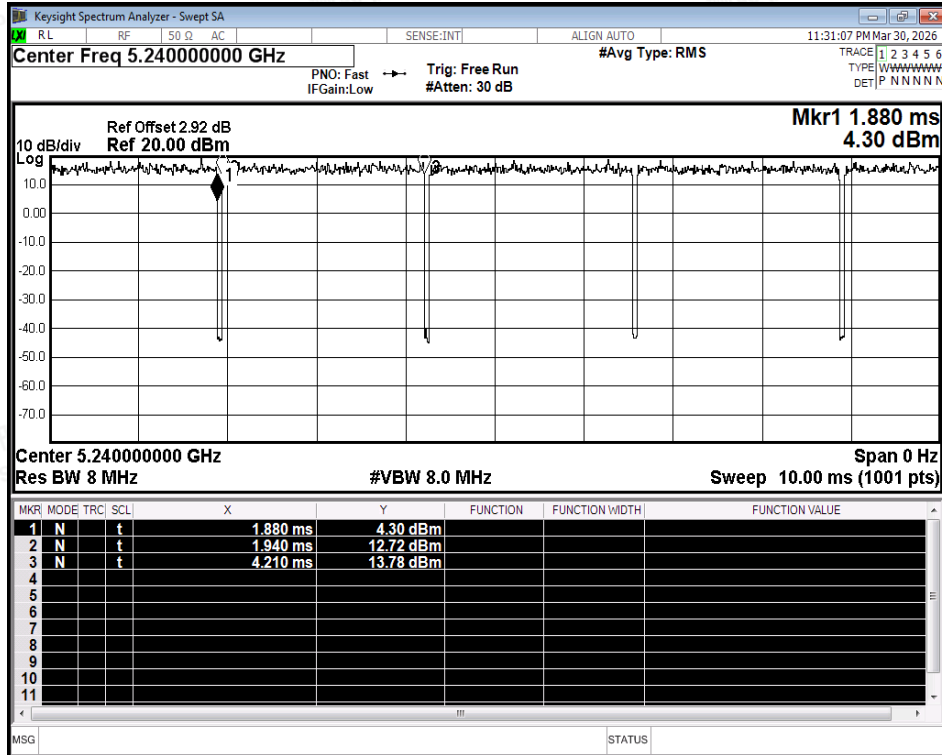

Duty Cycle NVNT ac20 5240MHz Ant2

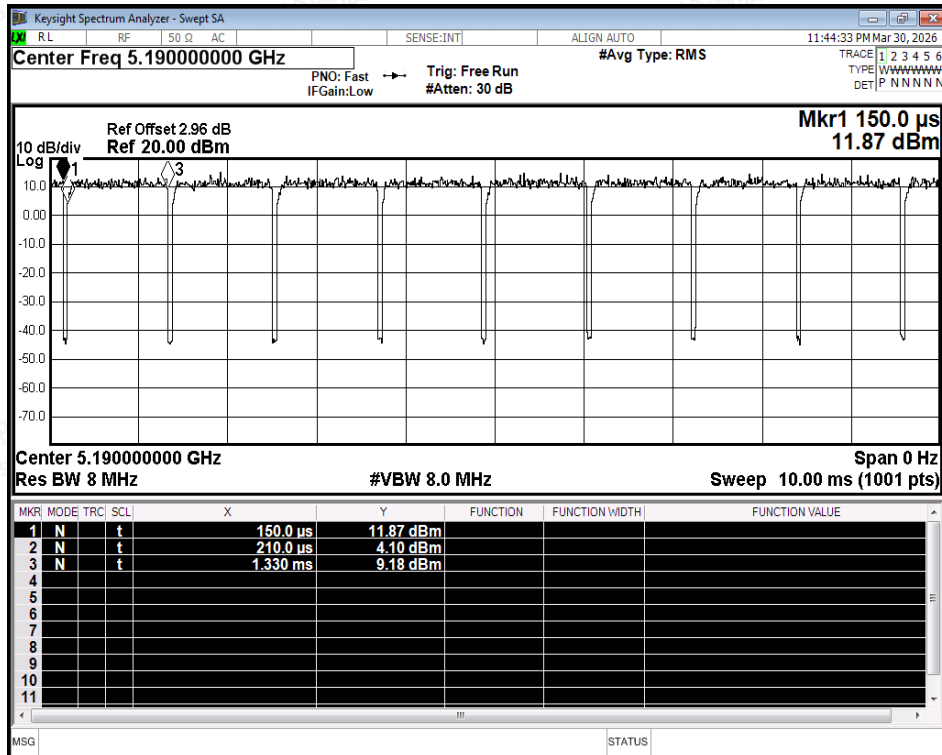

Duty Cycle NVNT ac40 5190MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

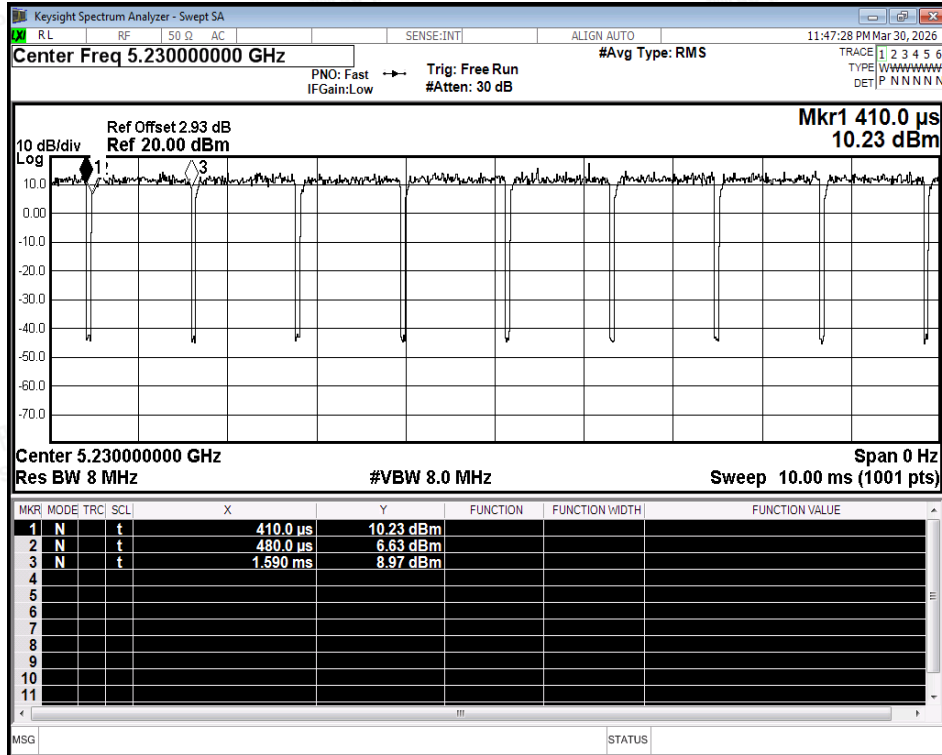

Duty Cycle NVNT ac40 5230MHz Ant2

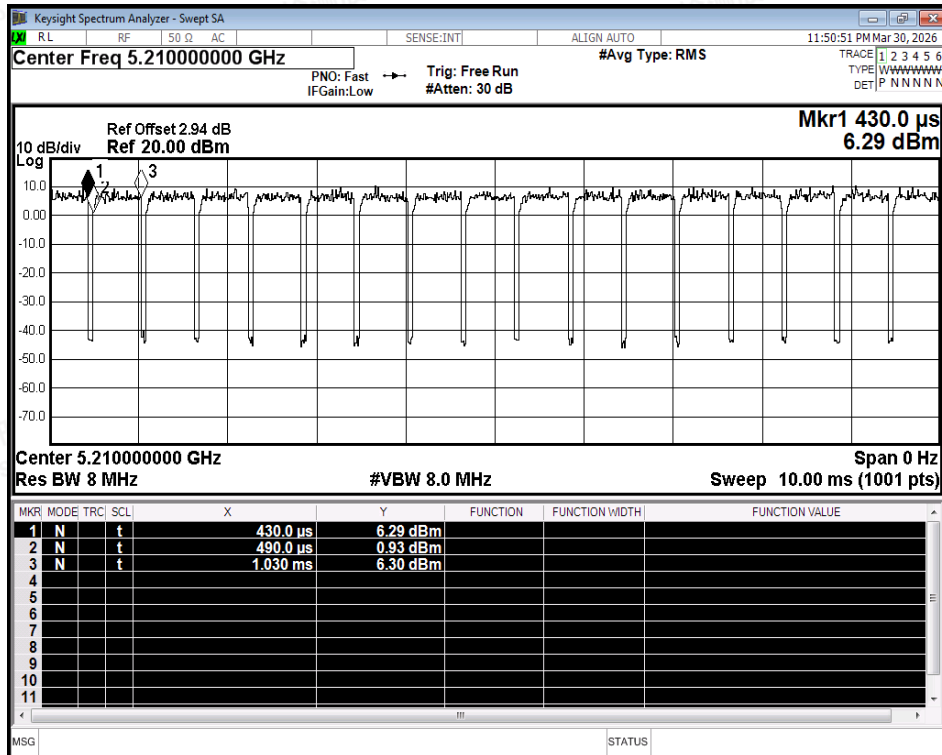

Duty Cycle NVNT ac80 5210MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity