


Appendix Test Data

Report No.:	1819C60062012501-01	Test Sample No.:	1-2-2
Start Test Date:	2026-5-26	Finish Test Date:	2026-5-29
Test Engineer:	Huisen Guan	Auditor:	Justin Feng
Temperature:	23°C	Relative Humidity:	64%
Pressure:	101kPa		

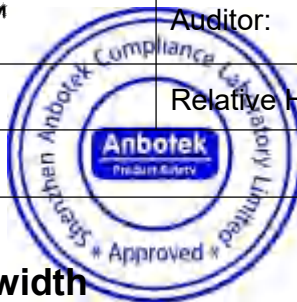


Appendix A: 20dB Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	20db EBW[MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	1.029	2401.469	2402.498	---	---
DH5	Ant1	2441	0.966	2440.523	2441.489	---	---
DH5	Ant1	2480	0.963	2479.529	2480.492	---	---
2DH5	Ant1	2402	1.371	2401.313	2402.684	---	---
2DH5	Ant1	2441	1.368	2440.316	2441.684	---	---
2DH5	Ant1	2480	1.371	2479.313	2480.684	---	---
3DH5	Ant1	2402	1.356	2401.316	2402.672	---	---
3DH5	Ant1	2441	1.359	2440.316	2441.675	---	---
3DH5	Ant1	2480	1.353	2479.316	2480.669	---	---


Test Graphs

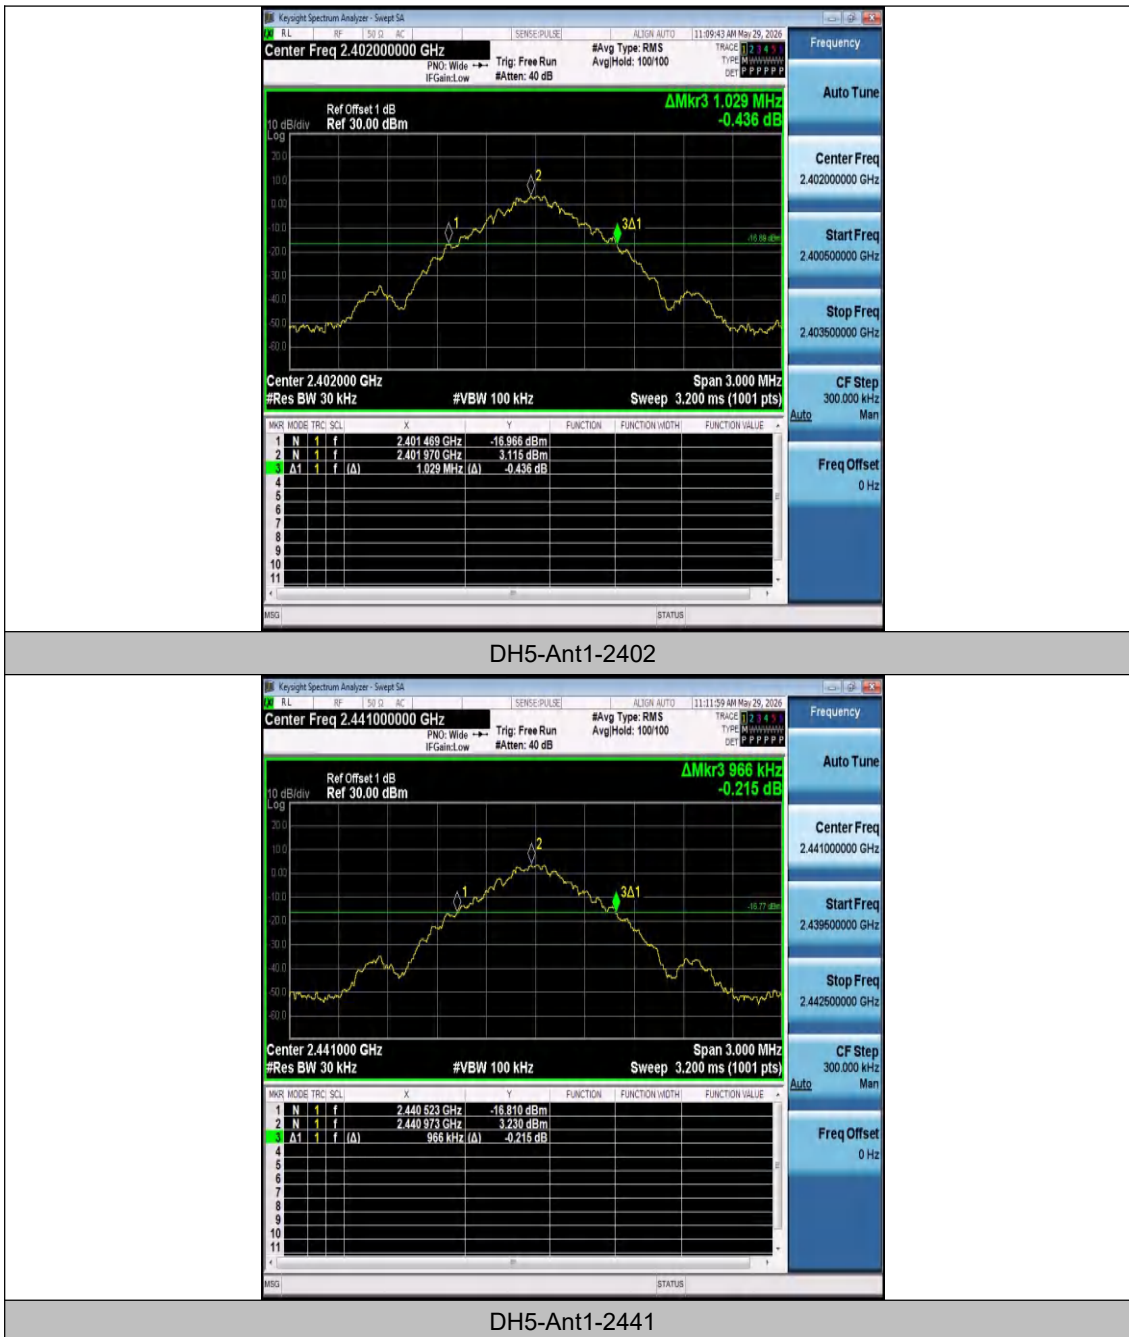

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

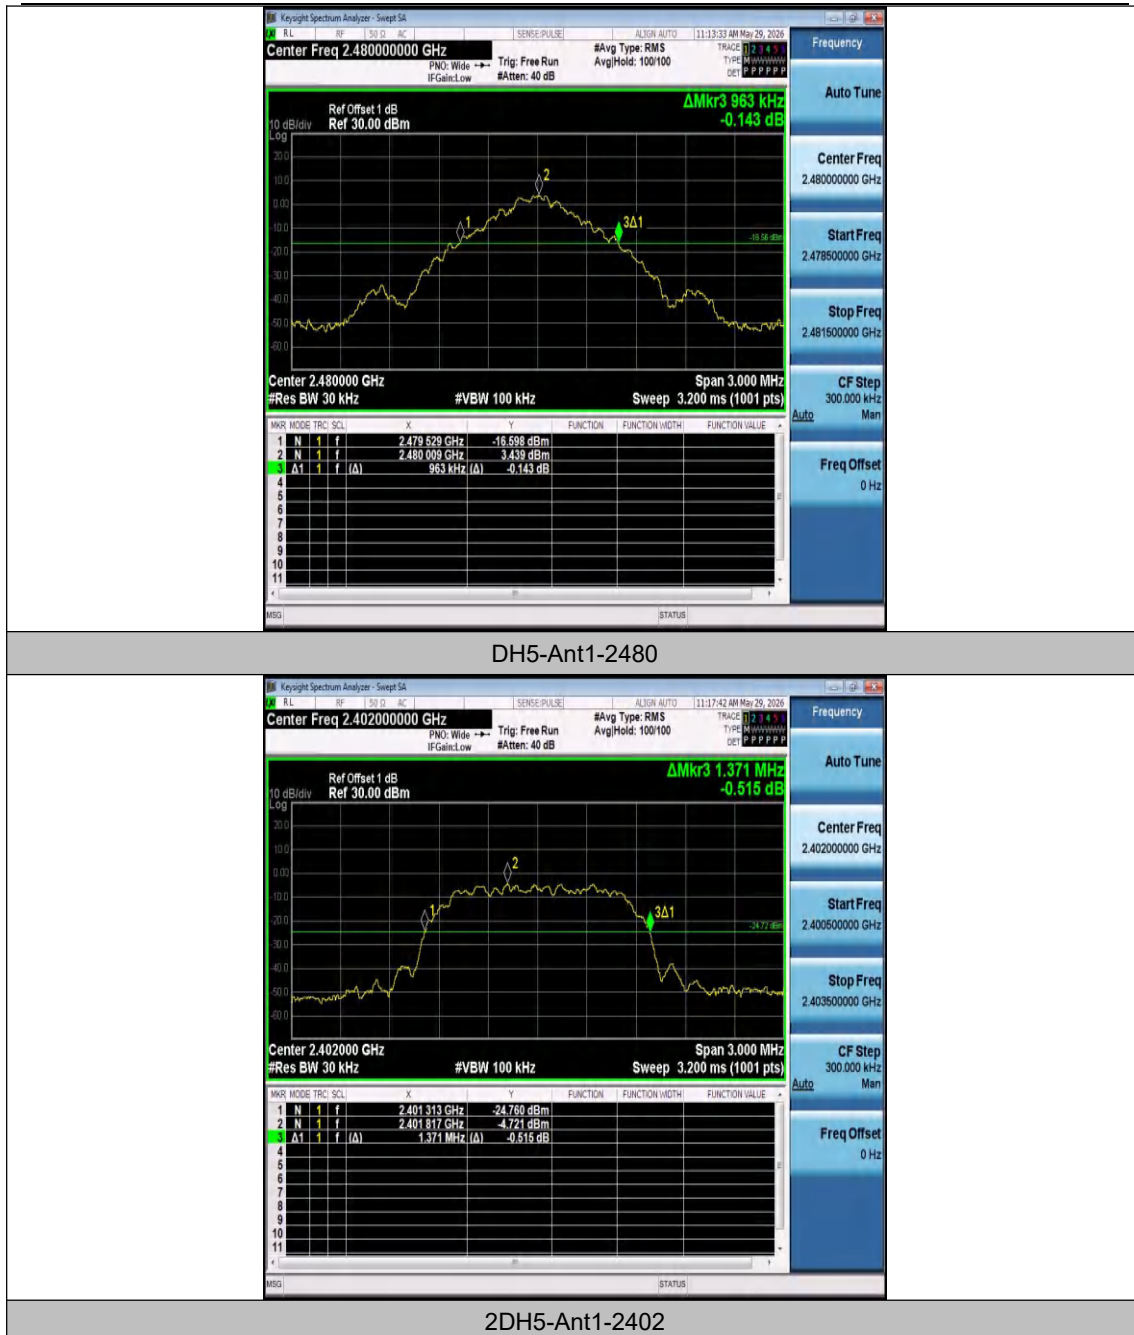





Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	0.89903	2401.5514	2402.4504	---	---
DH5	Ant1	2441	0.89565	2440.5525	2441.4481	---	---
DH5	Ant1	2480	0.89842	2479.5522	2480.4507	---	---
2DH5	Ant1	2402	1.2005	2401.3965	2402.5970	---	---
2DH5	Ant1	2441	1.1965	2440.4026	2441.5991	---	---
2DH5	Ant1	2480	1.1972	2479.3977	2480.5949	---	---
3DH5	Ant1	2402	1.2130	2401.3894	2402.6024	---	---
3DH5	Ant1	2441	1.2066	2440.3960	2441.6026	---	---
3DH5	Ant1	2480	1.2066	2479.3920	2480.5986	---	---

Test Graphs




Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com





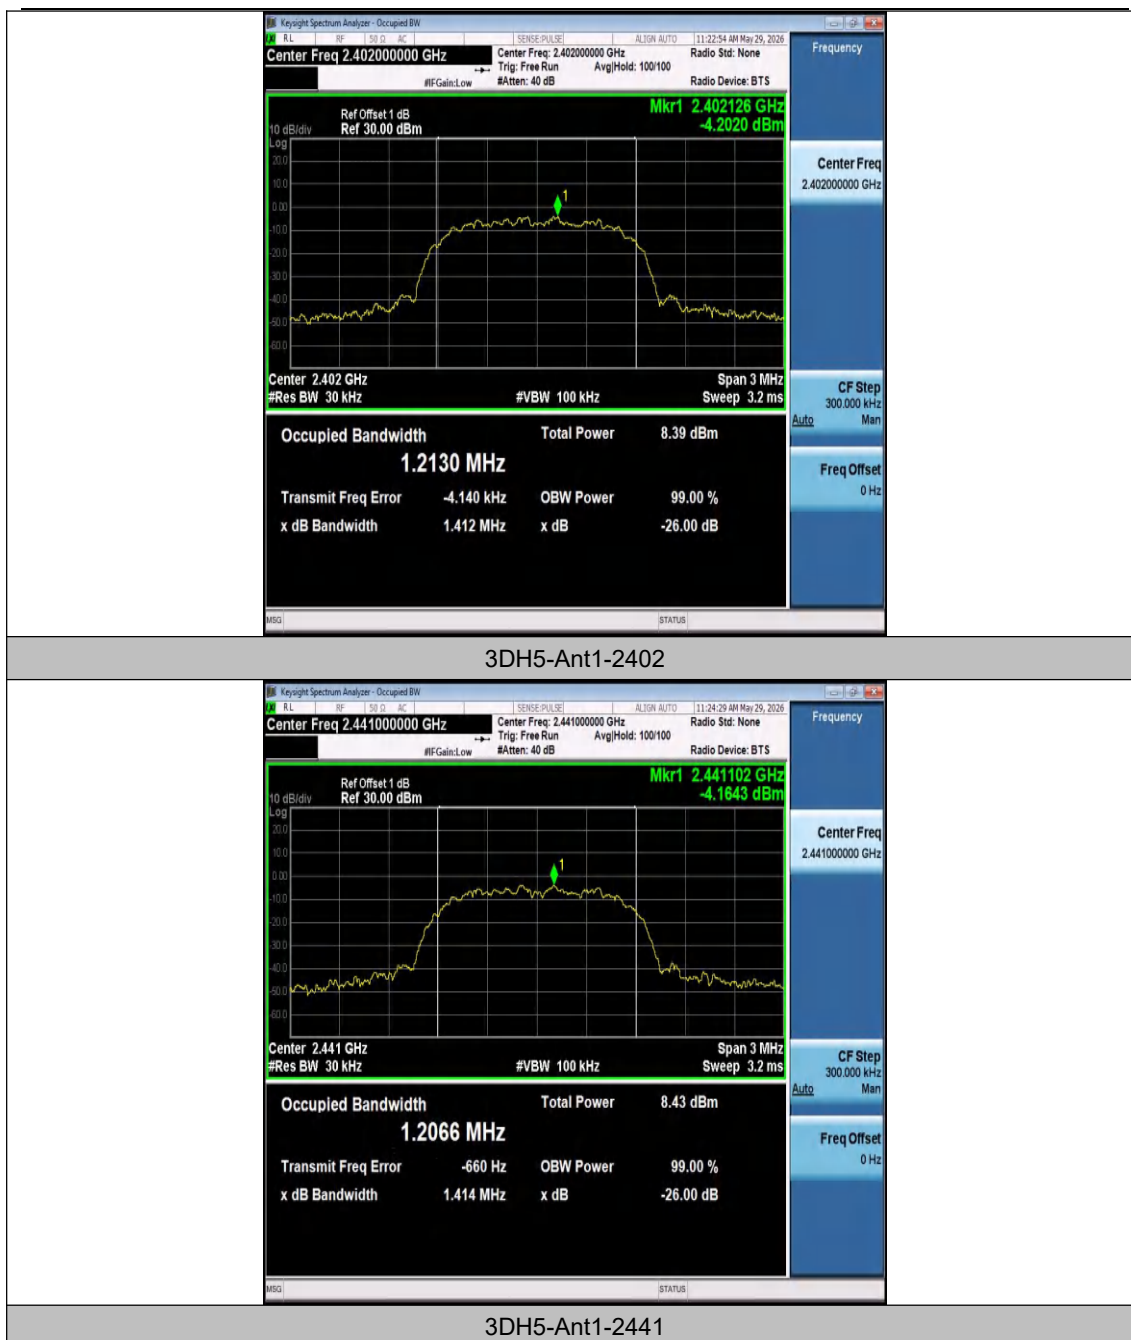

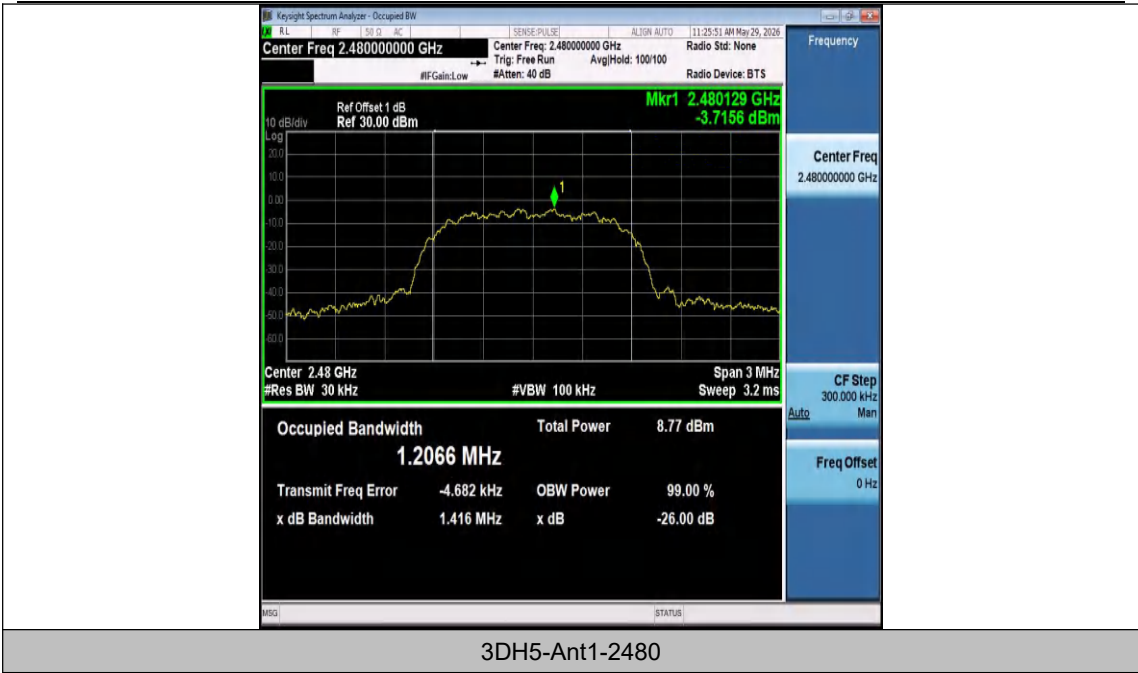

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix C: Maximum Conducted Output Power

Test Result Peak- Right Earbud

Test Mode	Antenna	Frequency[MHz]	Conducted Peak Power[dBm]	Conducted Limit[dBm]	Verdict
DH5	Ant1	2402	5.85	≤20.97	PASS
DH5	Ant1	2441	5.89	≤20.97	PASS
DH5	Ant1	2480	6.08	≤20.97	PASS
2DH5	Ant1	2402	4.26	≤20.97	PASS
2DH5	Ant1	2441	4.32	≤20.97	PASS
2DH5	Ant1	2480	4.50	≤20.97	PASS
3DH5	Ant1	2402	4.82	≤20.97	PASS
3DH5	Ant1	2441	4.86	≤20.97	PASS
3DH5	Ant1	2480	5.11	≤20.97	PASS

Test Graphs- Right Earbud

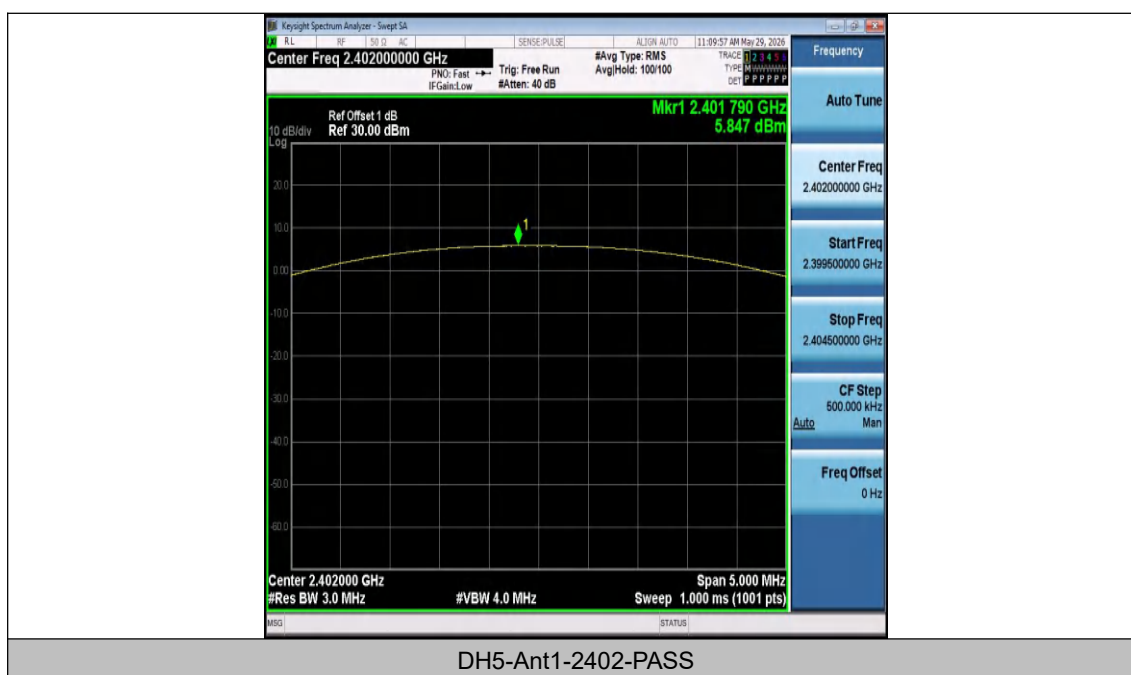




Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

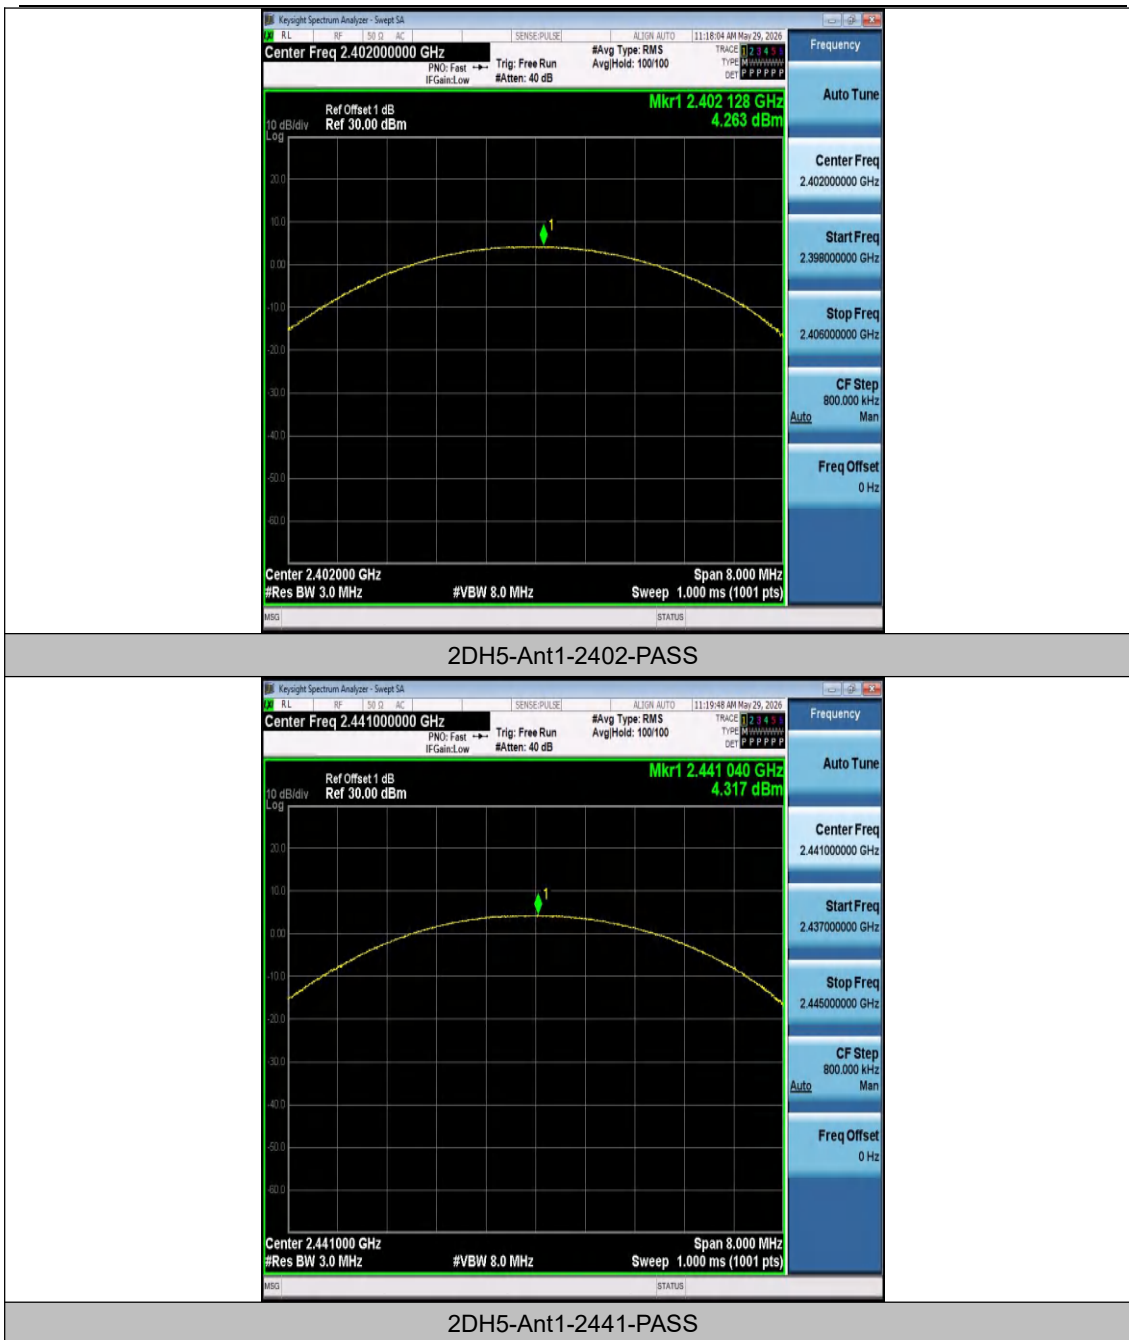

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

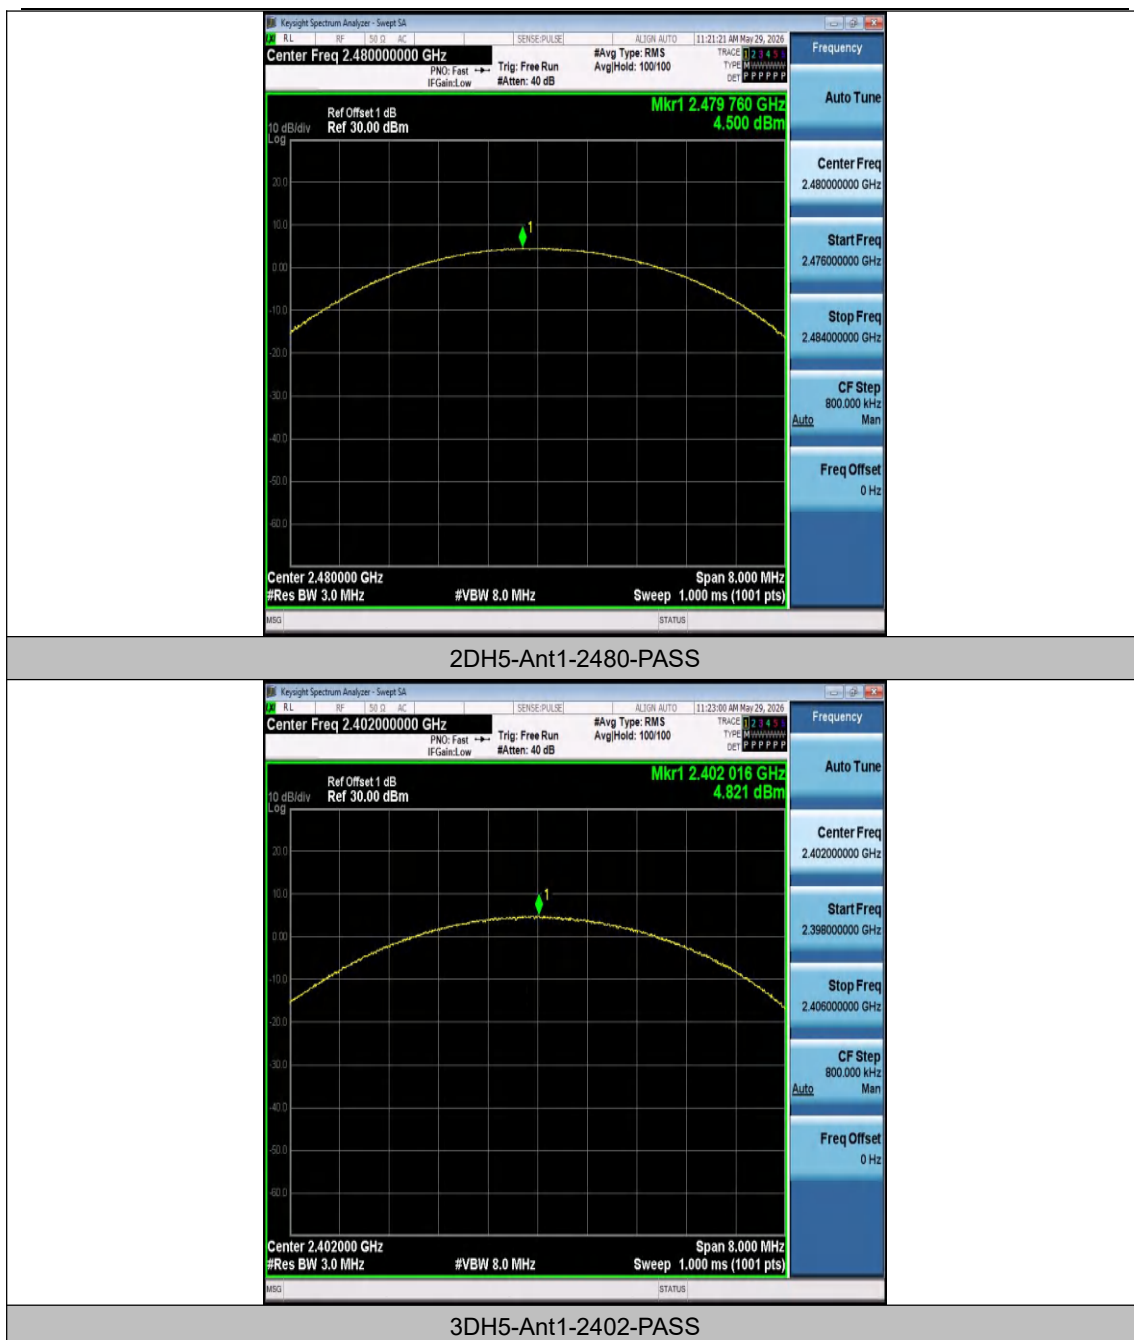

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

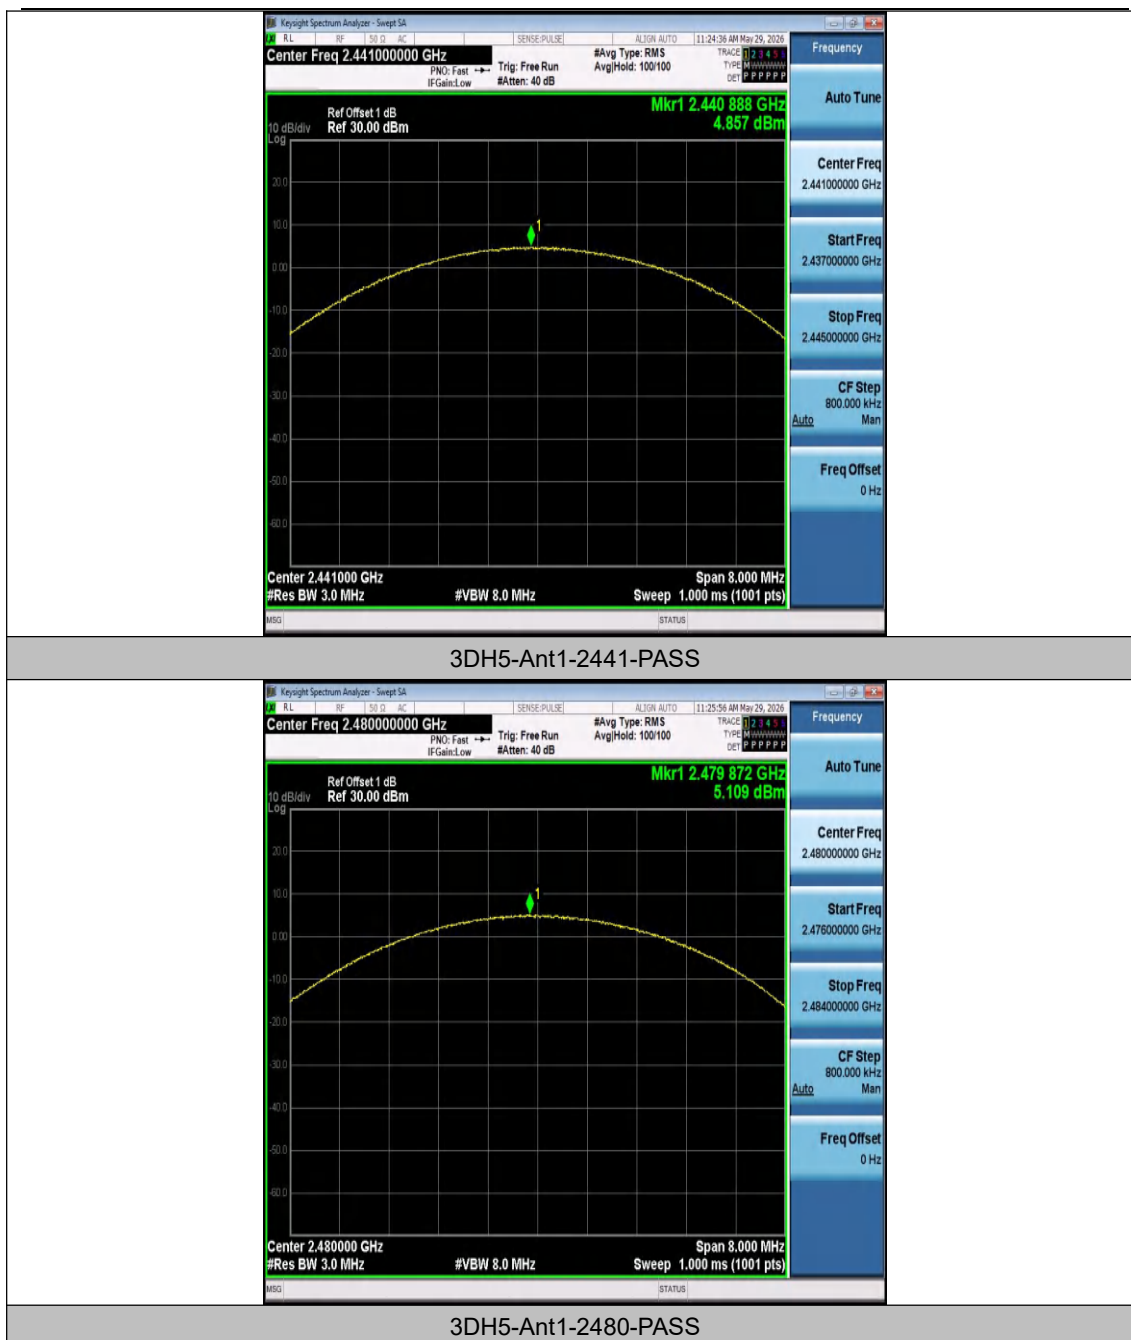

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Result Peak- Left Earbud

Test Mode	Antenna	Frequency[MHz]	Conducted Peak Power[dBm]	Conducted Limit[dBm]	Verdict
DH5	Ant1	2402	5.85	≤20.97	PASS
DH5	Ant1	2441	5.89	≤20.97	PASS
DH5	Ant1	2480	6.07	≤20.97	PASS
2DH5	Ant1	2402	4.26	≤20.97	PASS
2DH5	Ant1	2441	4.32	≤20.97	PASS
2DH5	Ant1	2480	4.51	≤20.97	PASS
3DH5	Ant1	2402	4.87	≤20.97	PASS
3DH5	Ant1	2441	4.90	≤20.97	PASS
3DH5	Ant1	2480	5.09	≤20.97	PASS

Test Graphs- Left Earbud

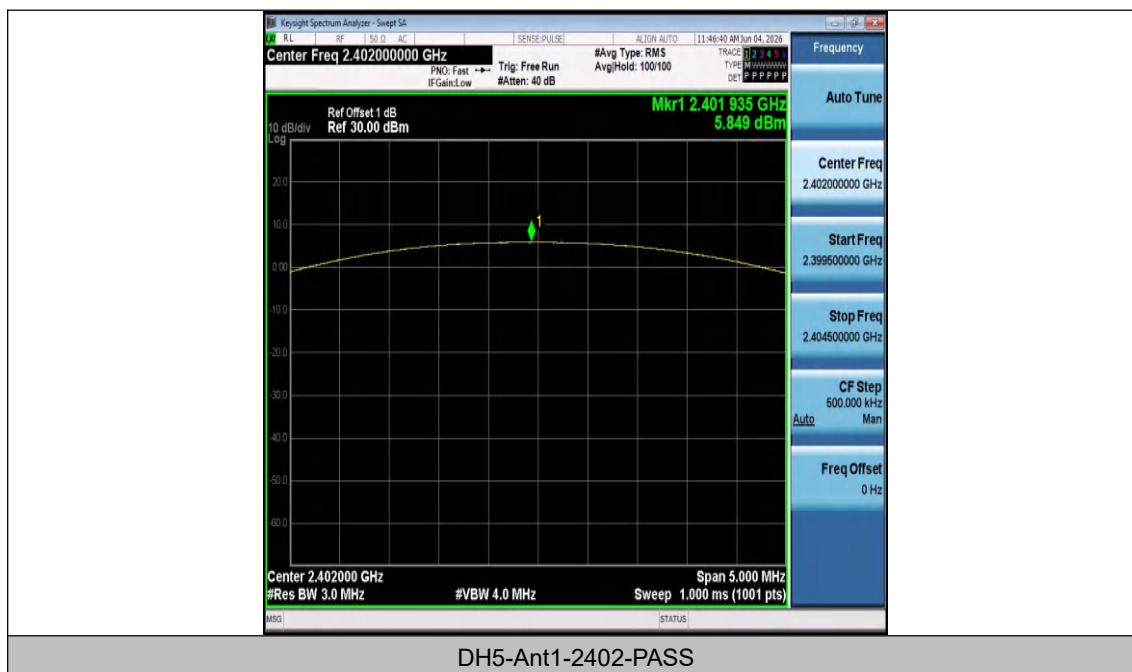


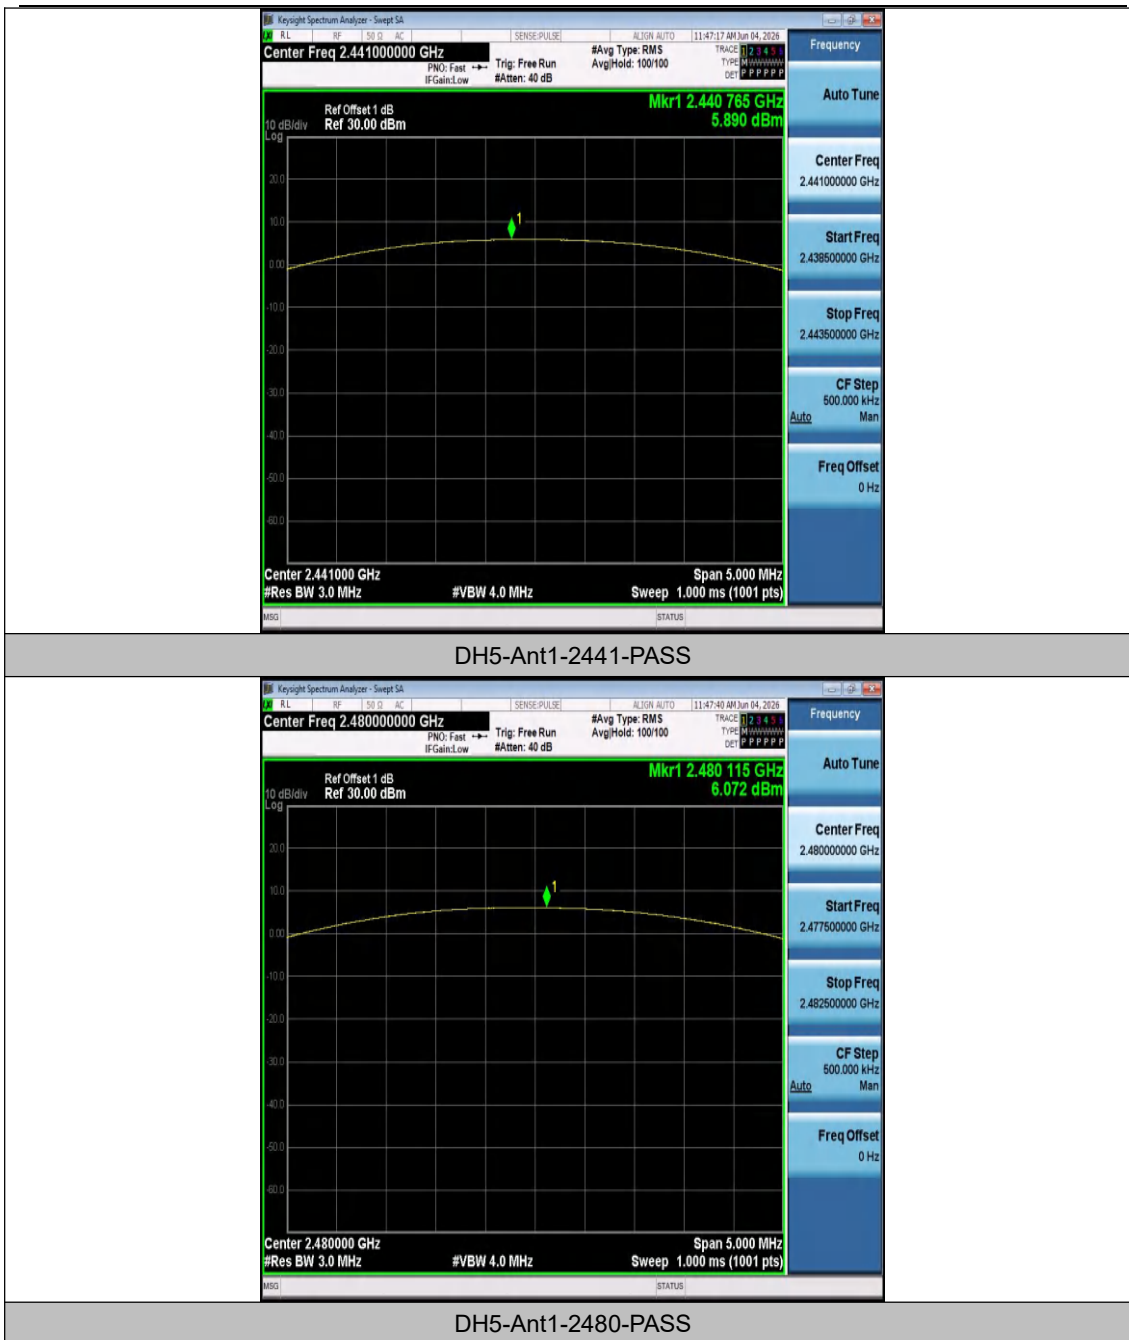

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

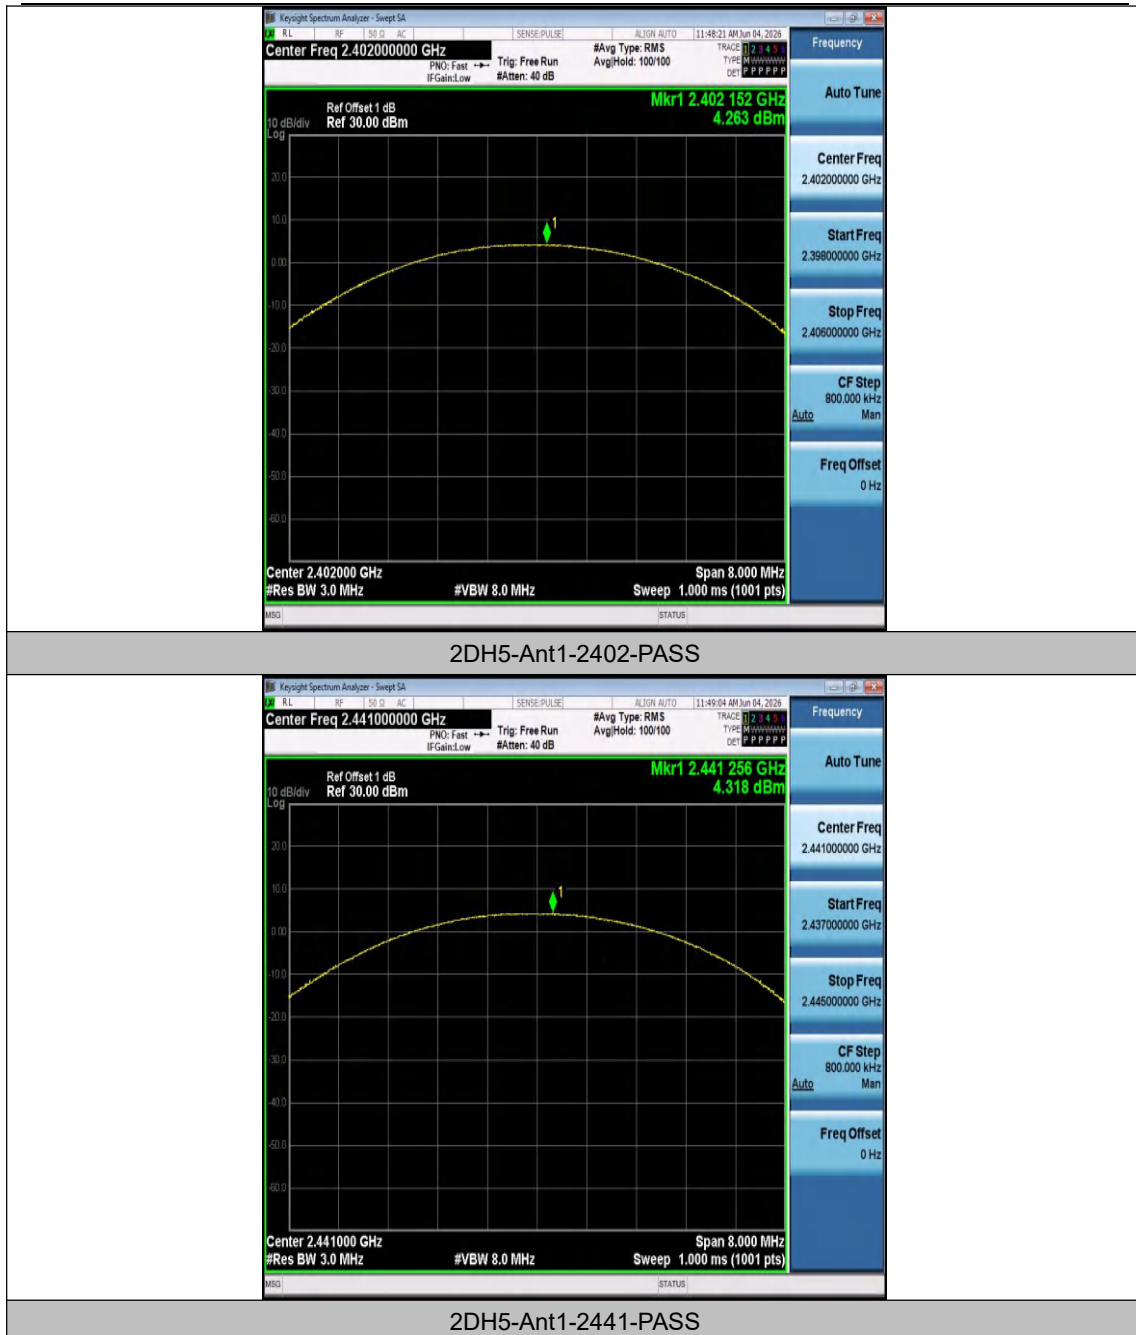

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

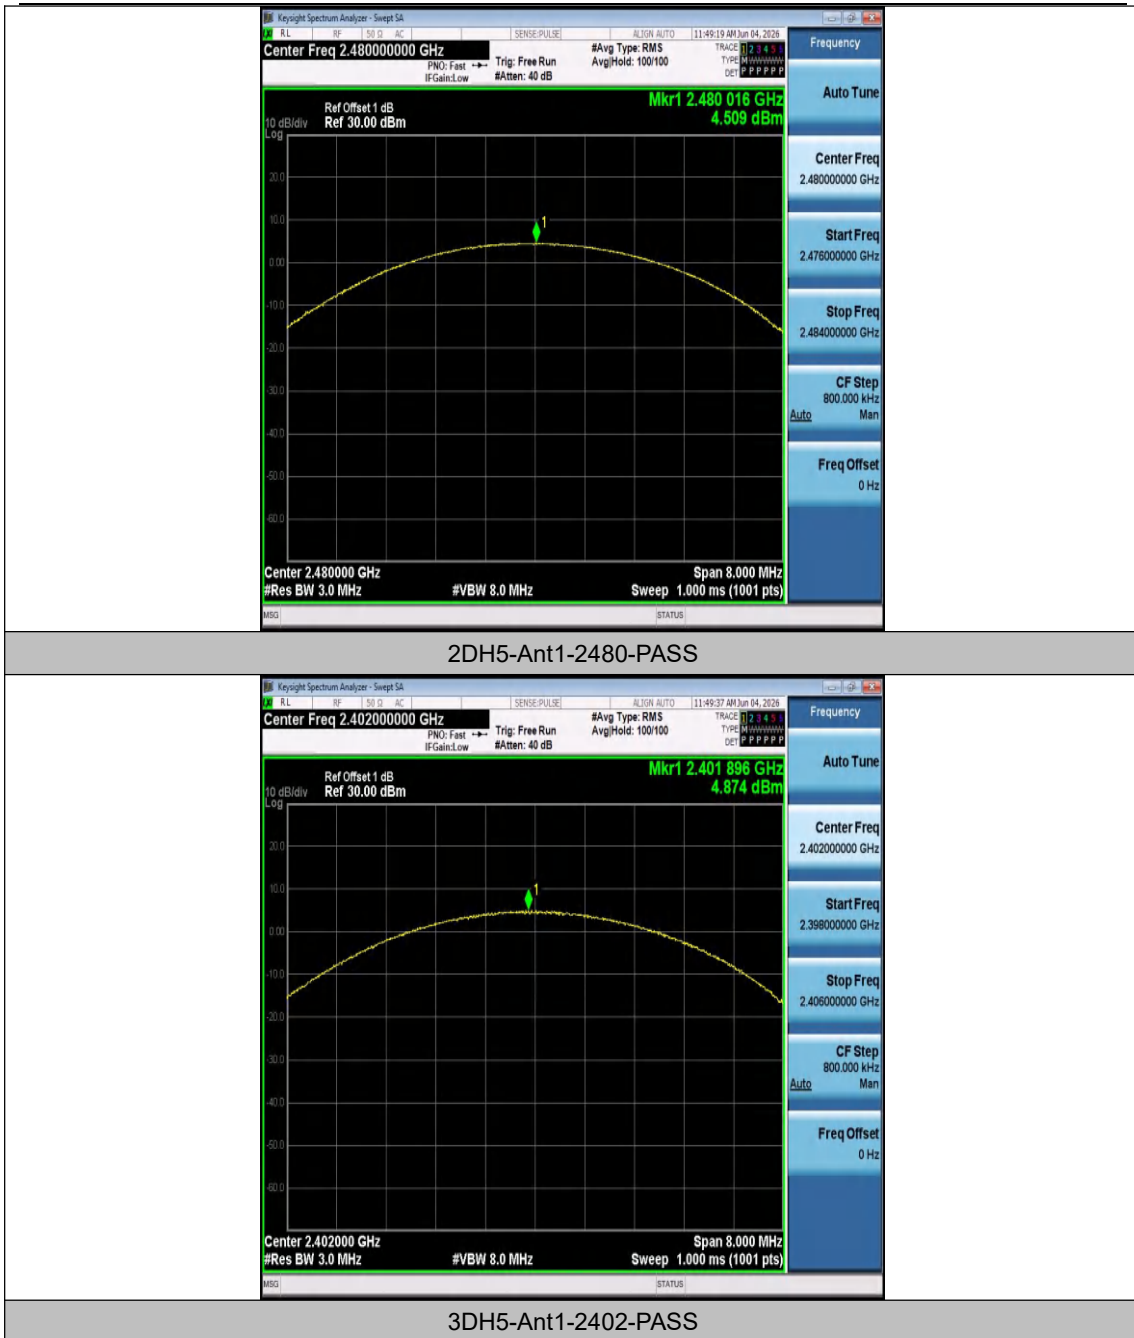

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

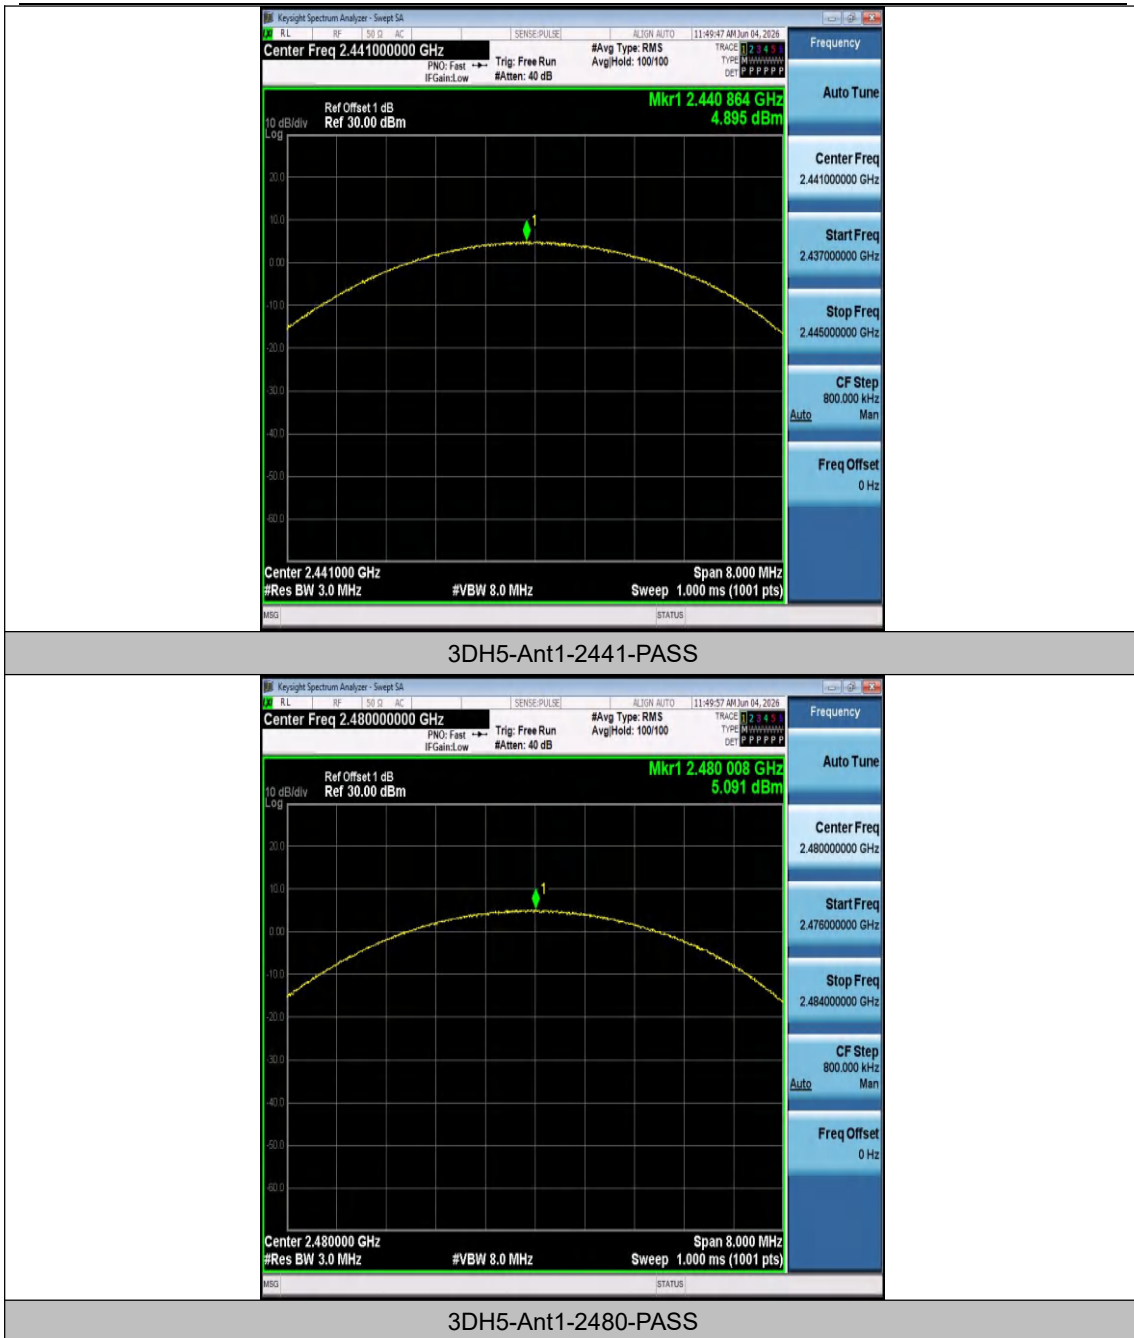

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix D: Carrier frequency separation

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [MHz]	Limit[MHz]	Verdict
DH5	Ant1	Hop	1.008	≥ 0.686	PASS
2DH5	Ant1	Hop	1.314	≥ 0.914	PASS
3DH5	Ant1	Hop	0.984	≥ 0.906	PASS

Note: For conducted power less than 0.125 W(20.97 dBm), the limit can be set using hopping channel carrier frequencies that are separated by 25 kHz or two thirds of the 20 dB bandwidth of the hopping channel, whichever is greater.


Test Graphs

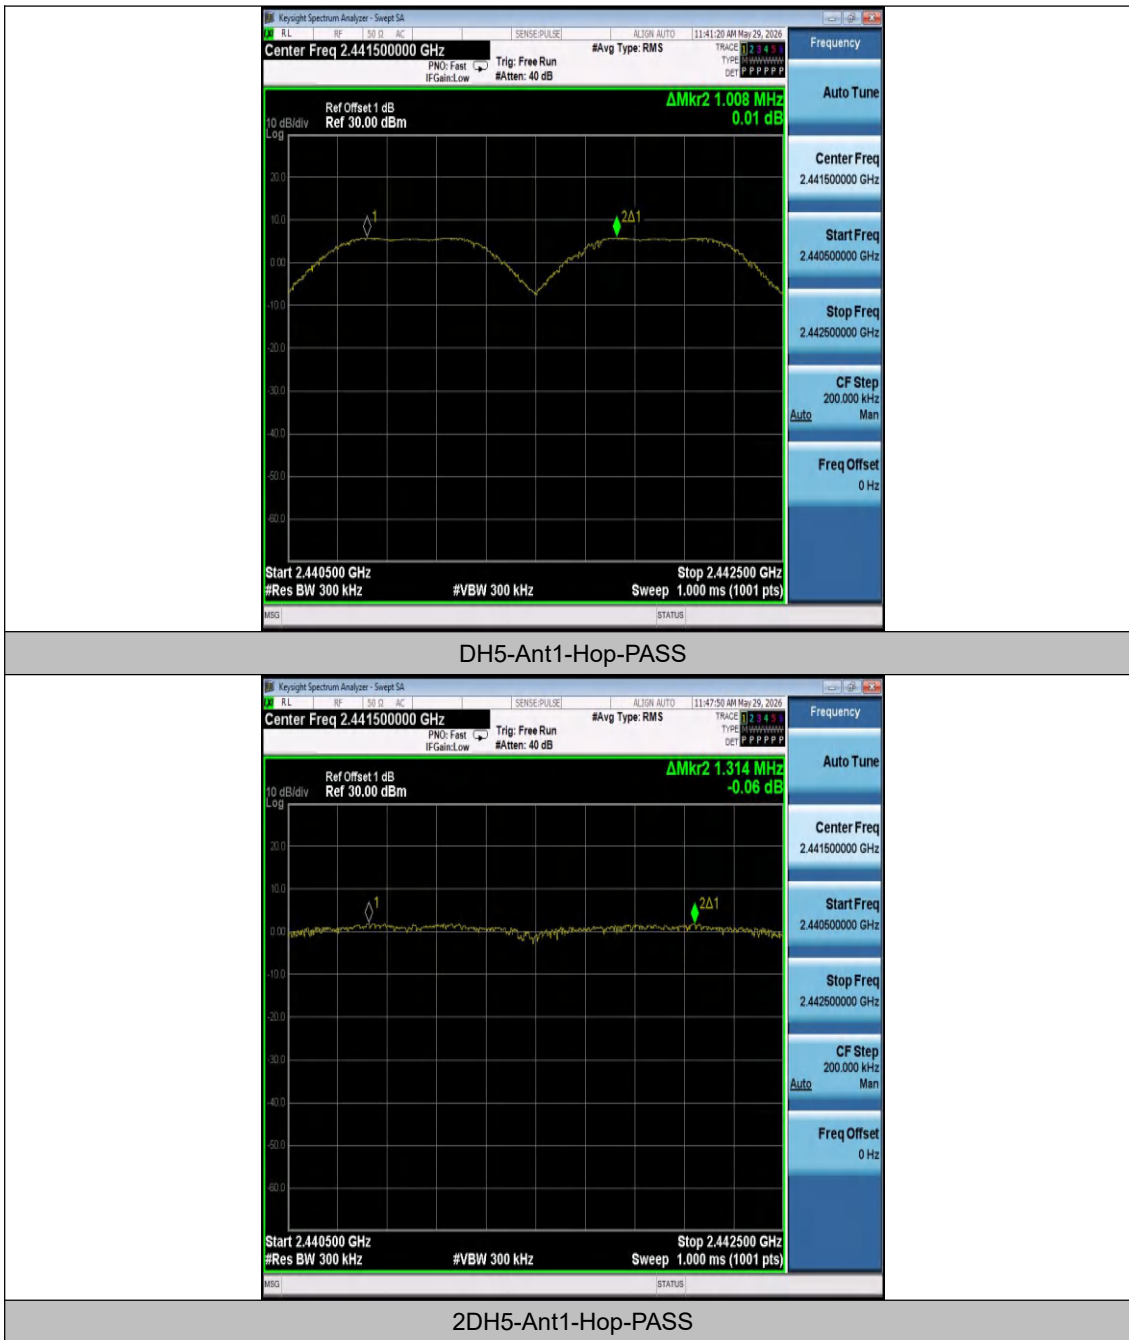

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

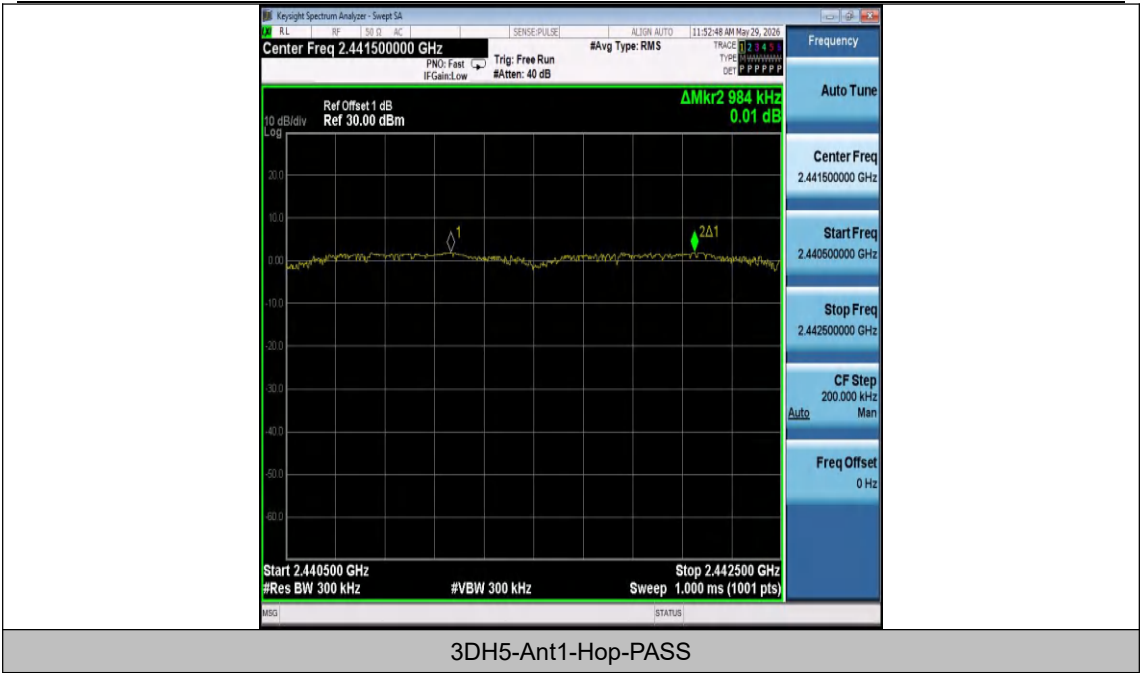

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Dwell Time

Test Result

Test Mode	Antenna	Frequency [MHz]	Burst Width [ms]	Total Hops [Num]	Result [s]	Limit [s]	Verdict
DH5	Ant1	Hop	2.888	123	0.355	≤0.4	PASS
2DH5	Ant1	Hop	2.883	103	0.297	≤0.4	PASS
3DH5	Ant1	Hop	2.888	112	0.323	≤0.4	PASS


Test Graphs

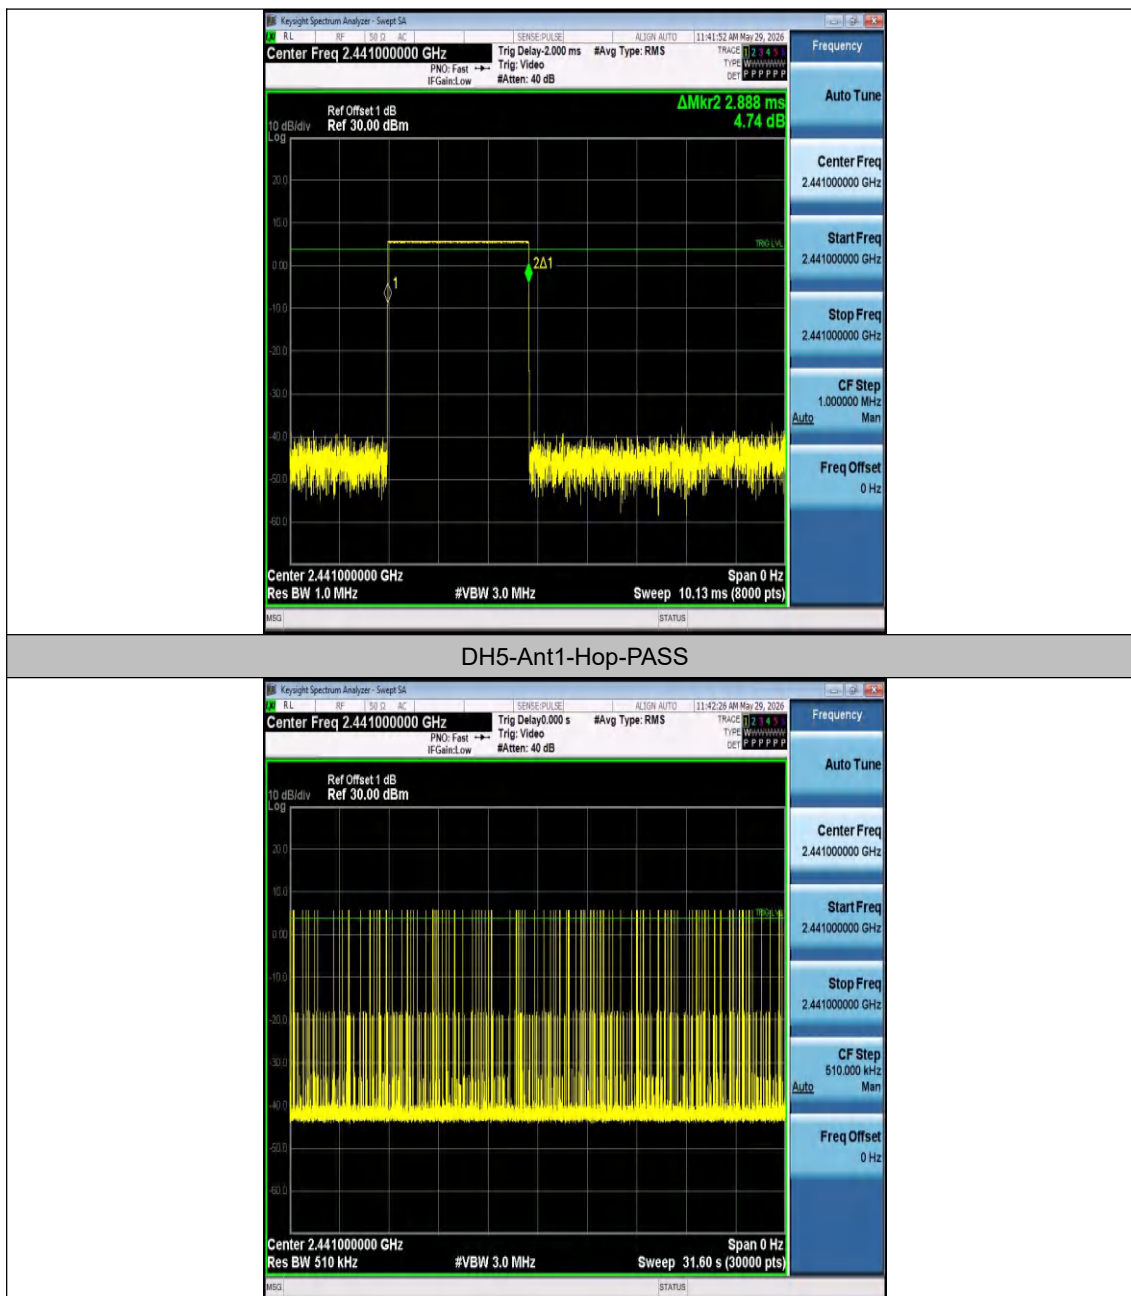

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

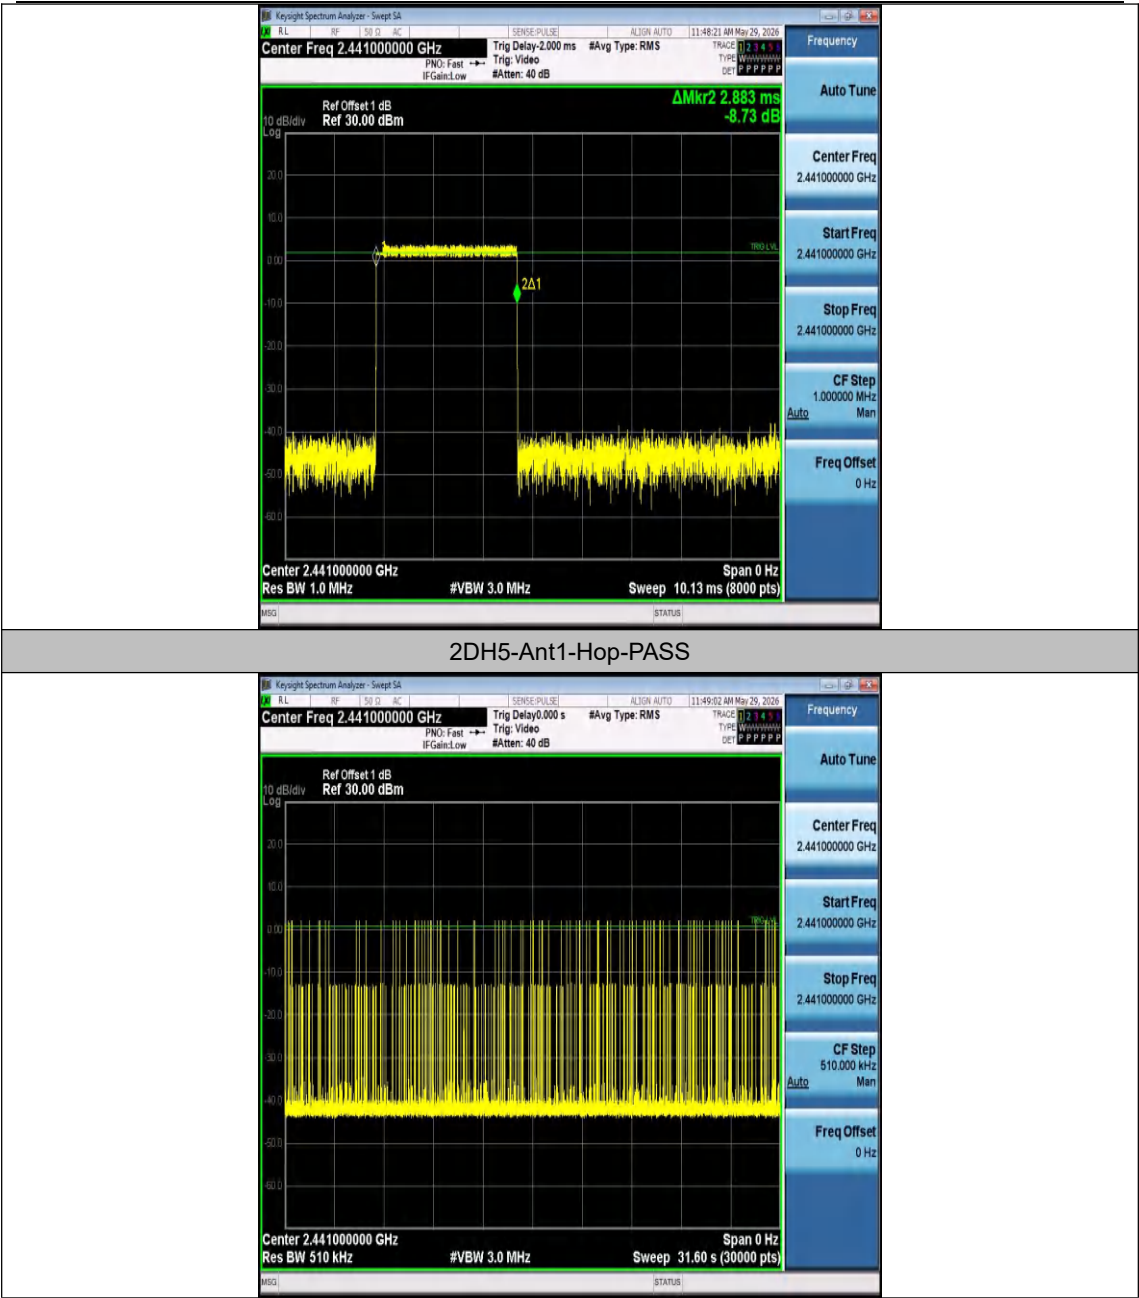

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

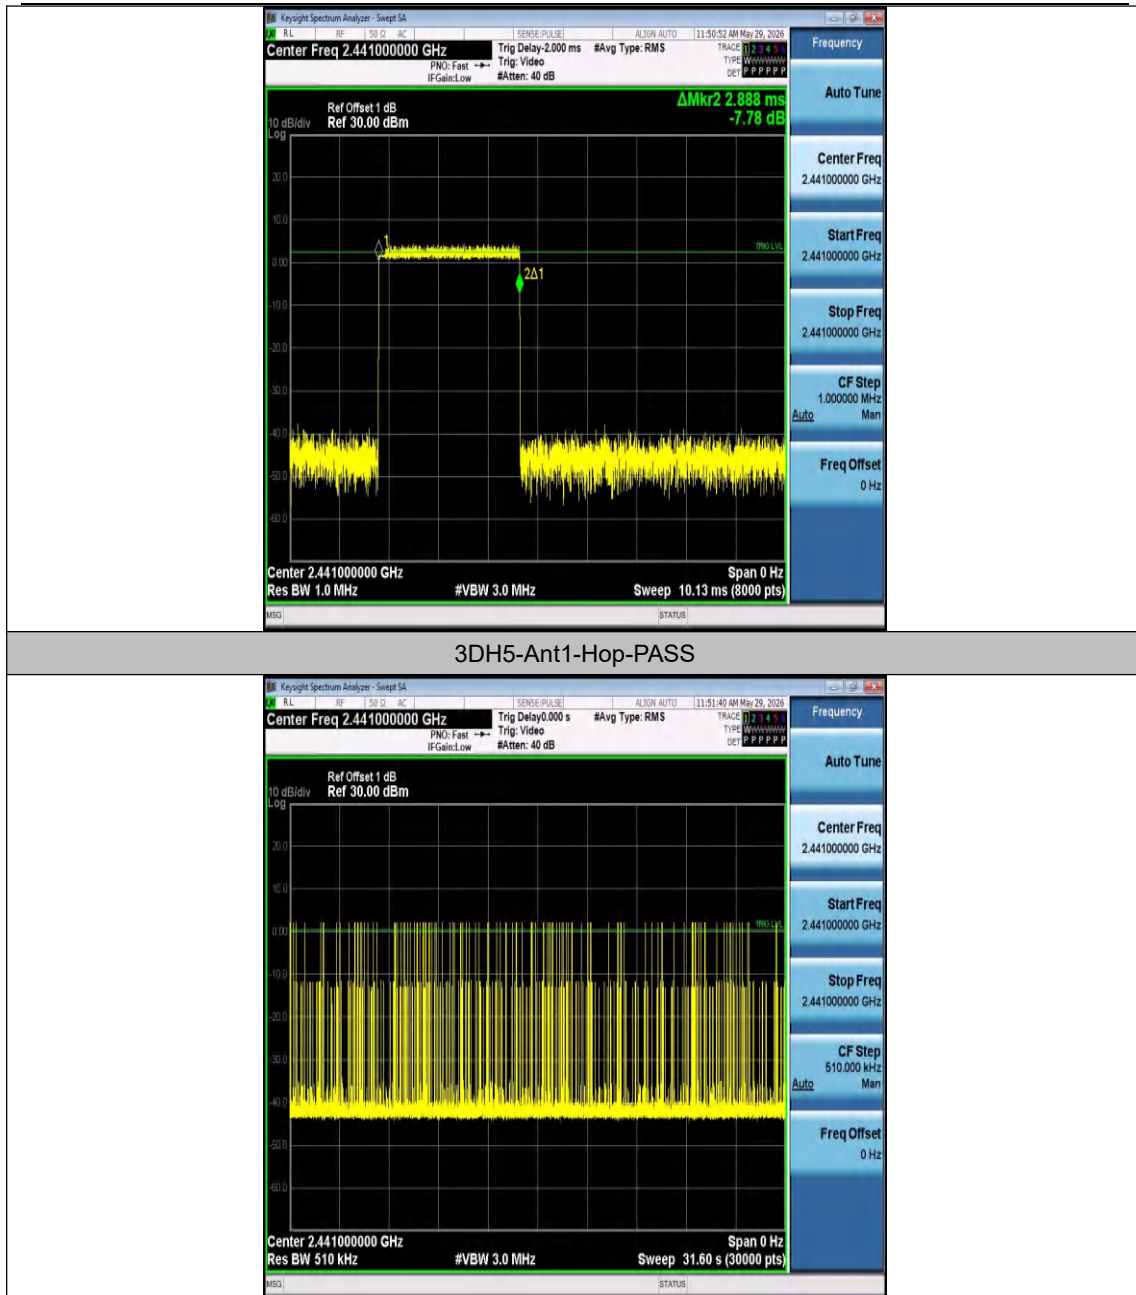

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix F: Number of Hopping Channel

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [Num]	Limit [Num]	Verdict
DH5	Ant1	Hop	79	≥15	PASS
2DH5	Ant1	Hop	79	≥15	PASS
3DH5	Ant1	Hop	79	≥15	PASS


Test Graphs

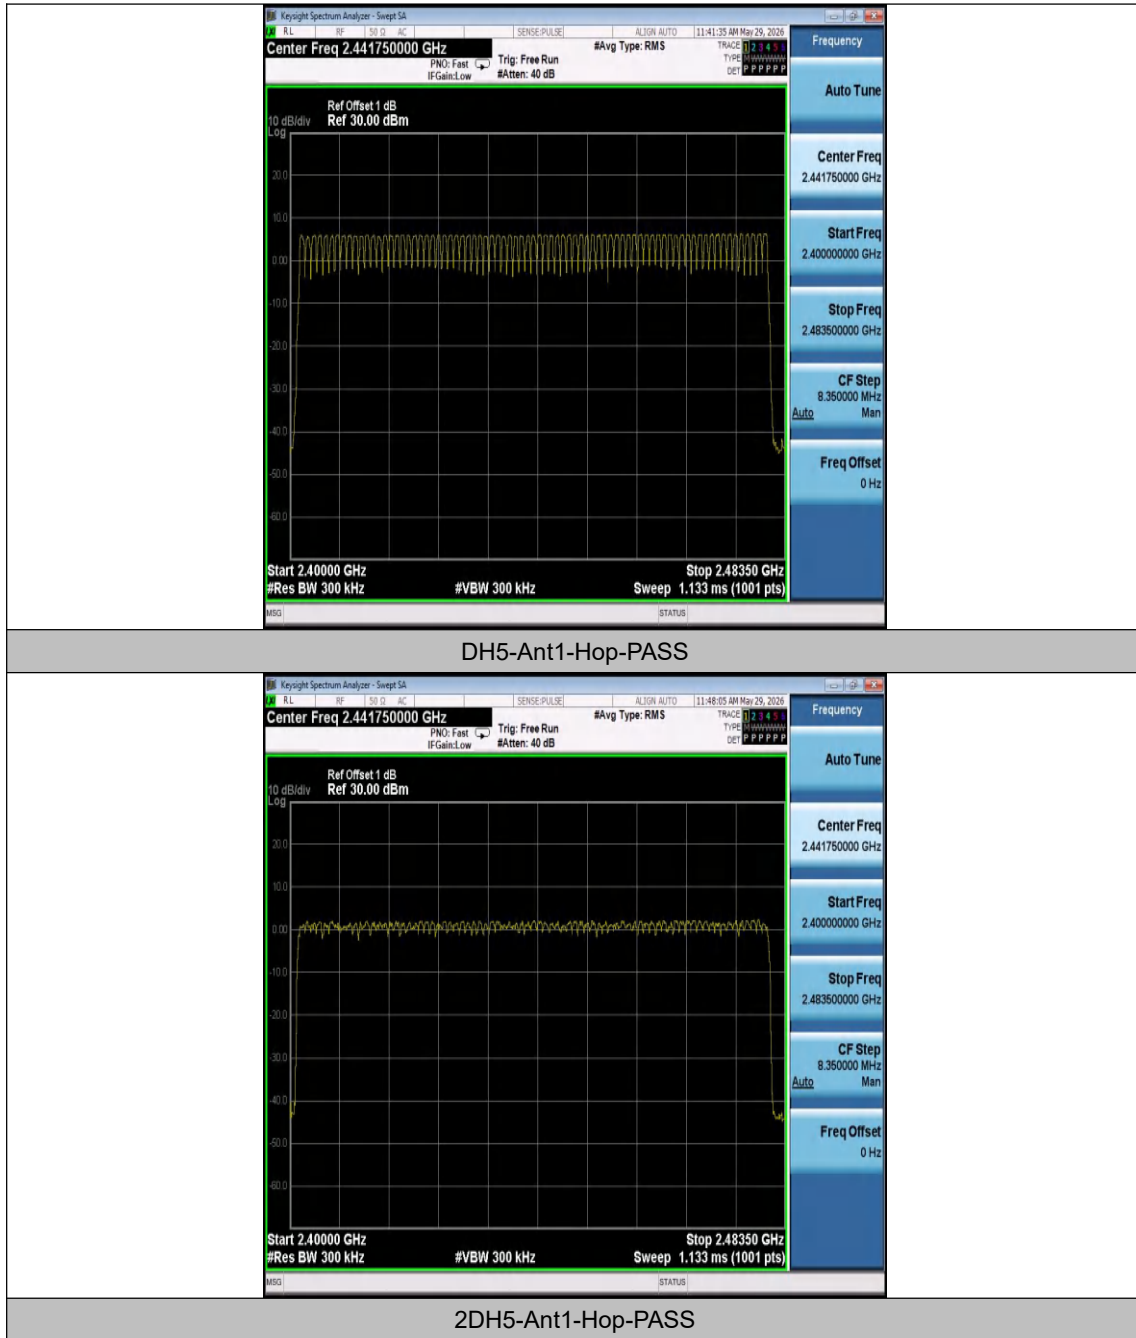

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

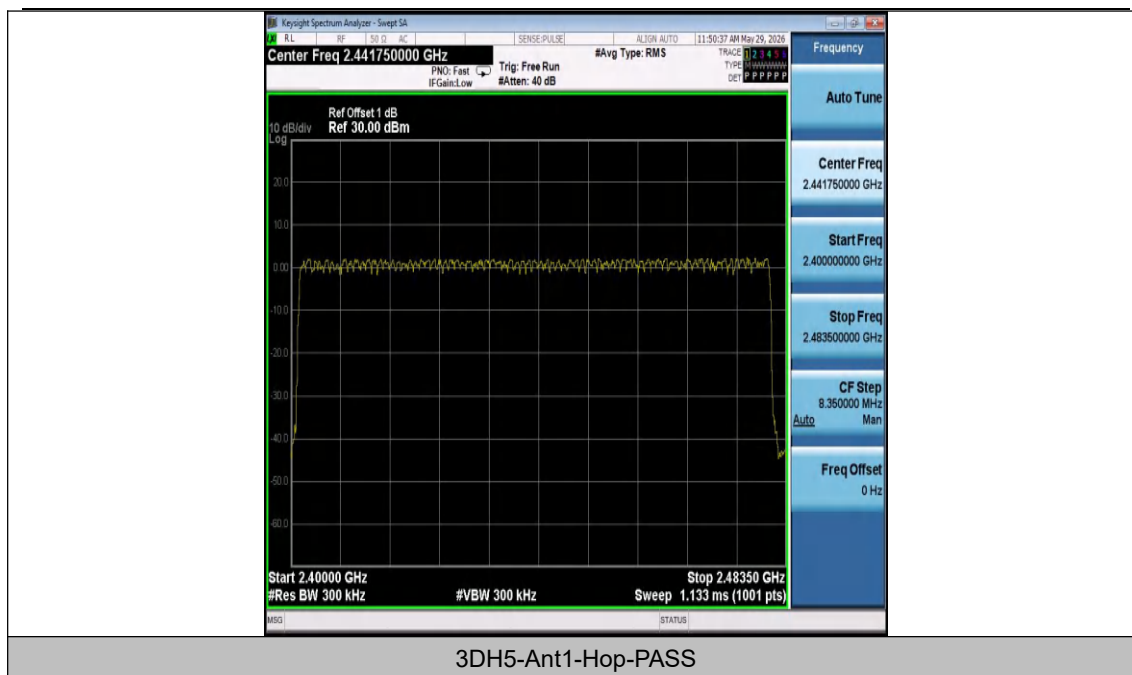

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix G: Conducted Band edge

Test Result

Test Mode	Antenna	Ch. Name	Frequency [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	Low	2402	5.54	-50.82	≤-14.46	PASS
DH5	Ant1	High	2480	5.86	-51.18	≤-14.15	PASS
DH5	Ant1	Low	Hop_2402	5.31	-52.94	≤-14.7	PASS
DH5	Ant1	High	Hop_2480	5.73	-52.8	≤-14.27	PASS
2DH5	Ant1	Low	2402	0.05	-47.79	≤-19.95	PASS
2DH5	Ant1	High	2480	0.33	-50.82	≤-19.68	PASS
2DH5	Ant1	Low	Hop_2402	-0.40	-48.87	≤-20.4	PASS
2DH5	Ant1	High	Hop_2480	0.31	-53.25	≤-19.69	PASS
3DH5	Ant1	Low	2402	0.23	-46.73	≤-19.77	PASS
3DH5	Ant1	High	2480	0.55	-51.27	≤-19.45	PASS
3DH5	Ant1	Low	Hop_2402	0.87	-51.42	≤-19.14	PASS
3DH5	Ant1	High	Hop_2480	0.61	-53.28	≤-19.4	PASS

Remark:Regarding the spurious emissions from 30MHz to 26.5GHz, the cable loss have been set in the 'offset' of the Spectrum Analyzer during the test.


Test Graphs

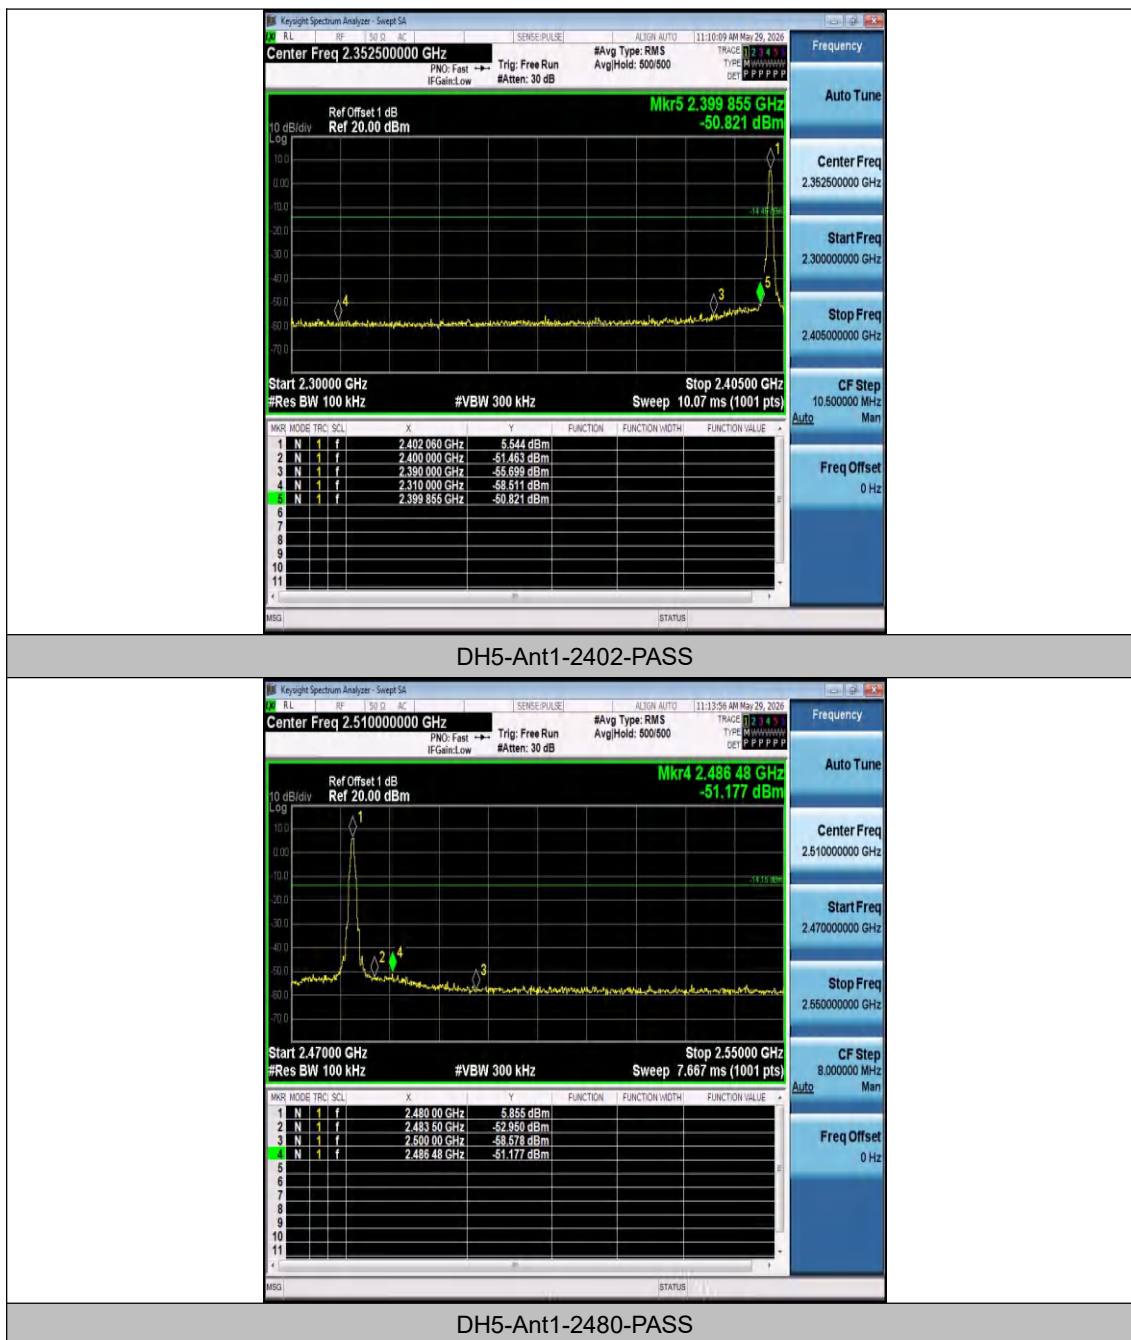


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

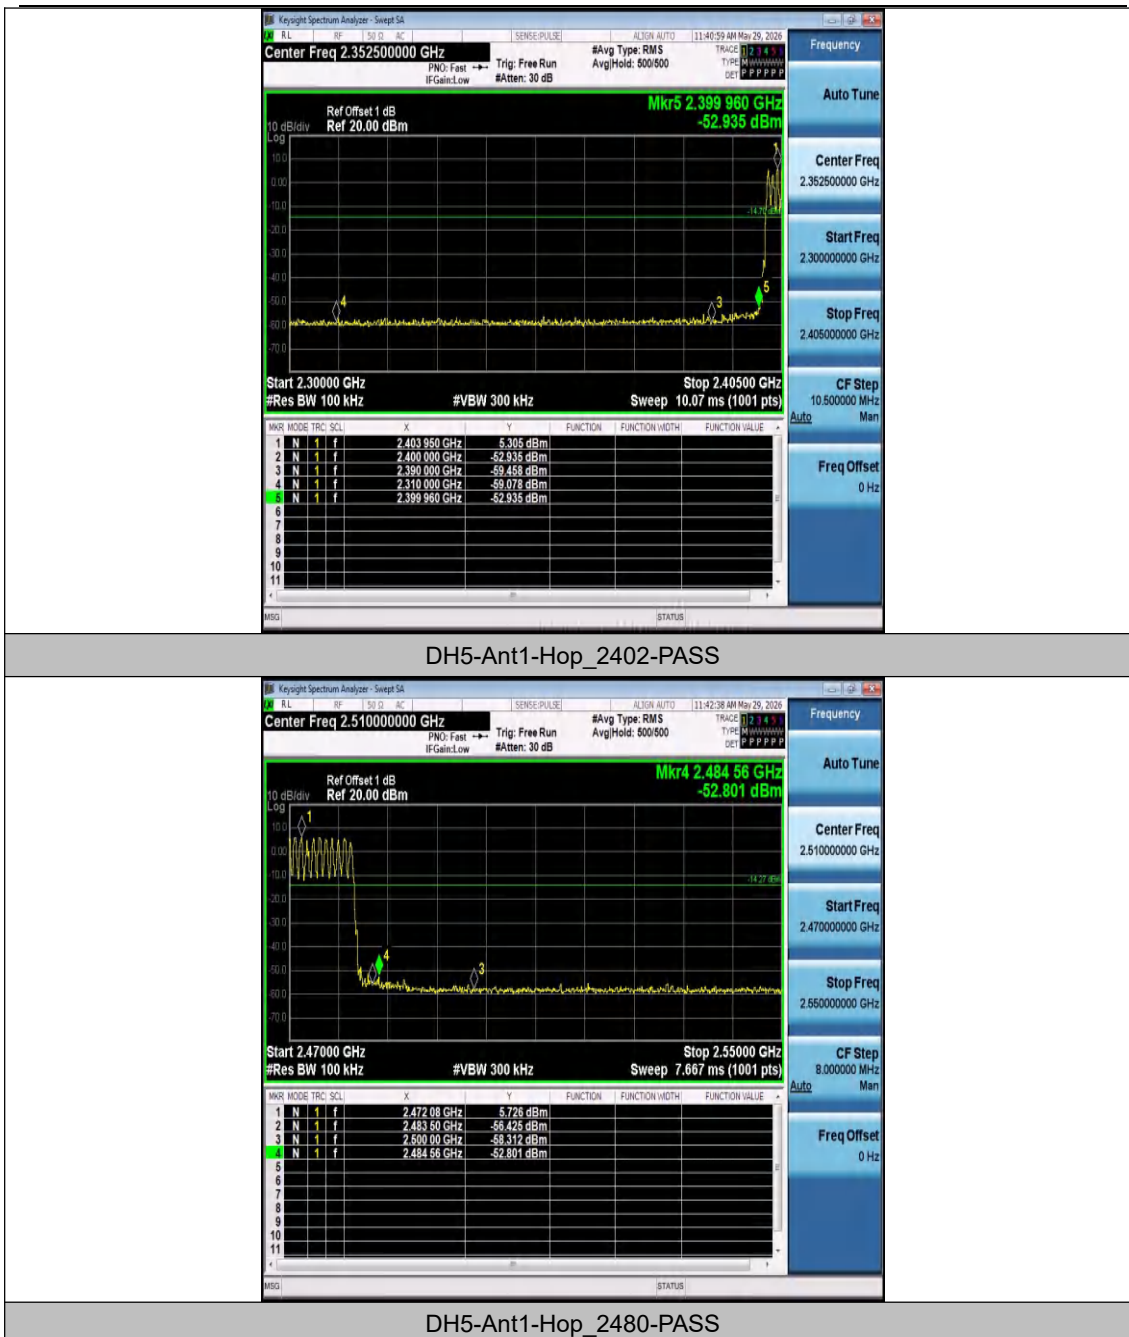


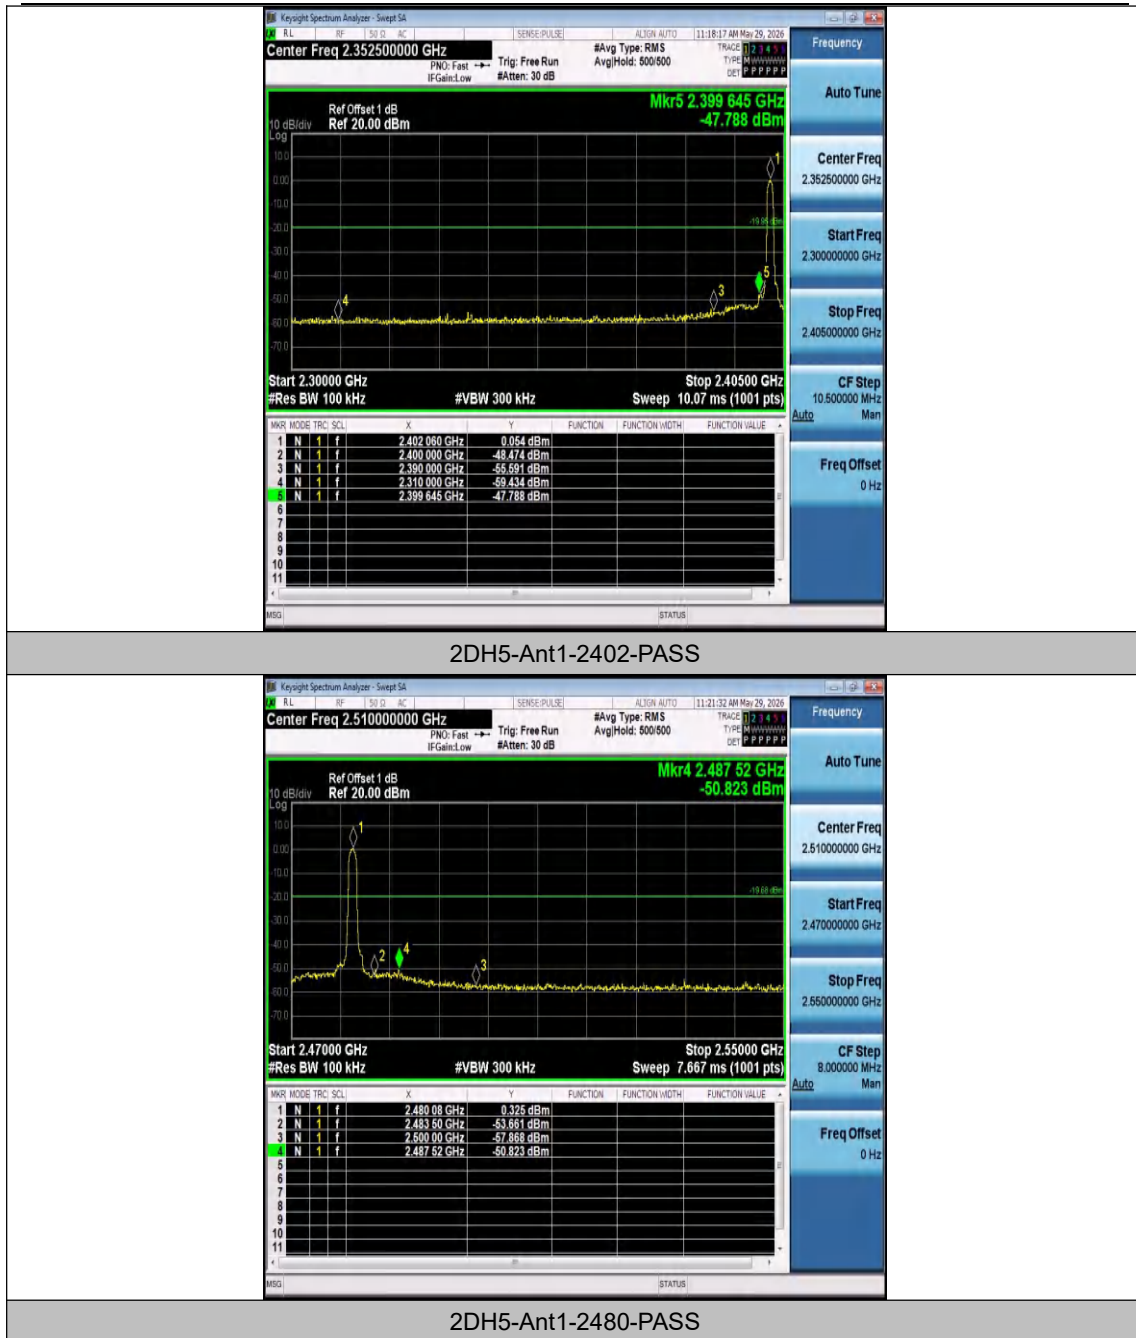

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

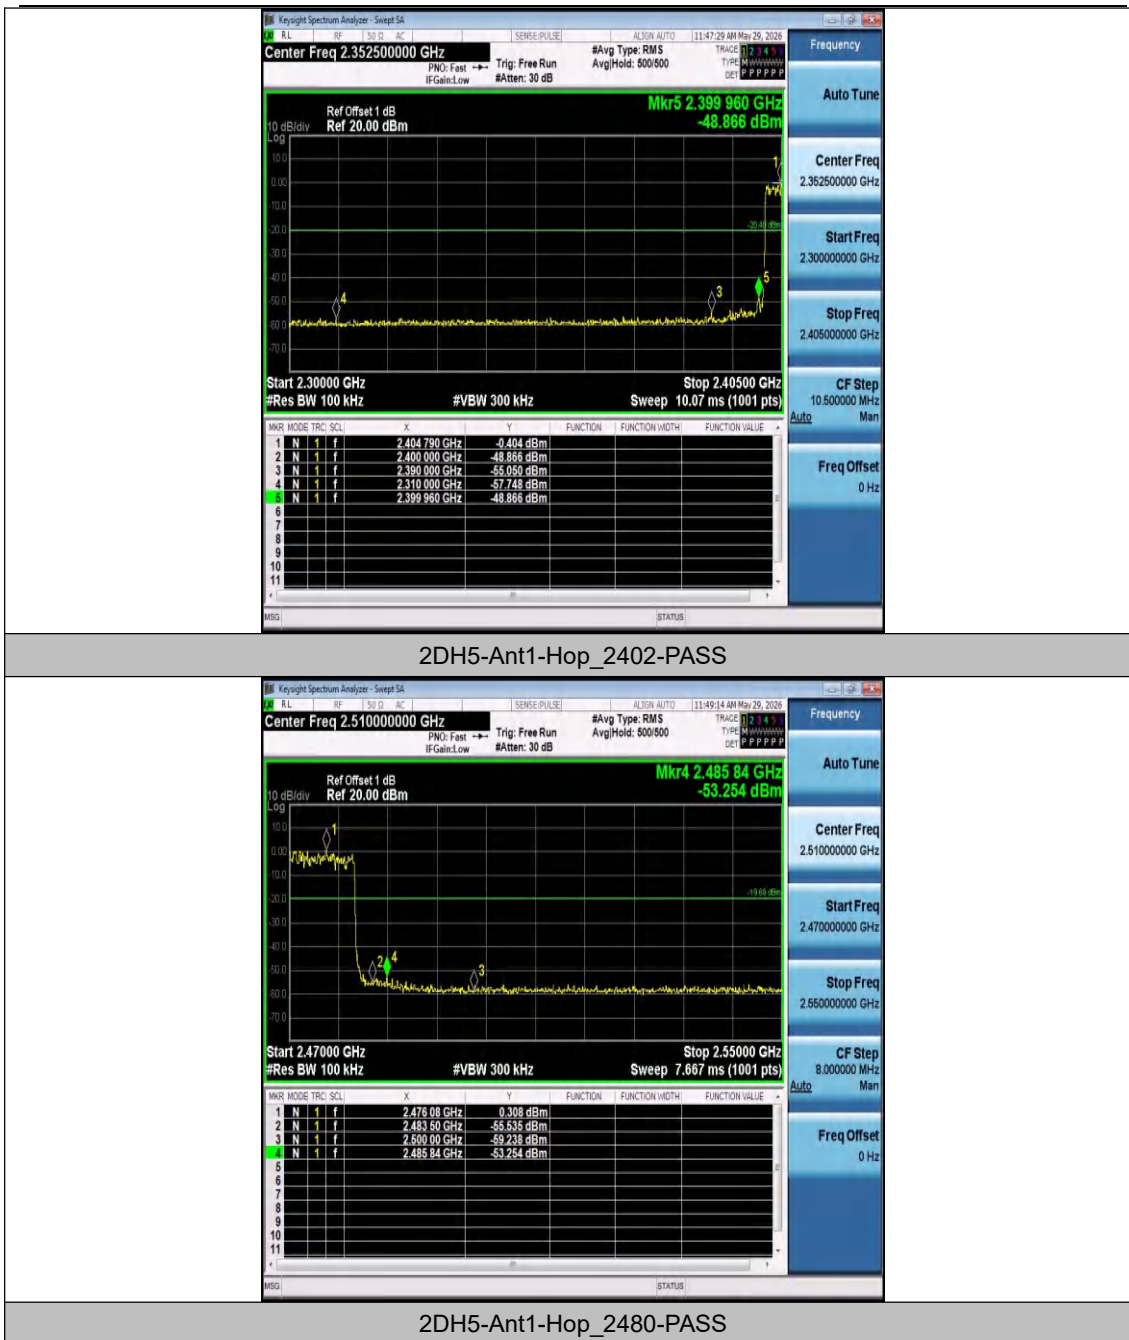


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

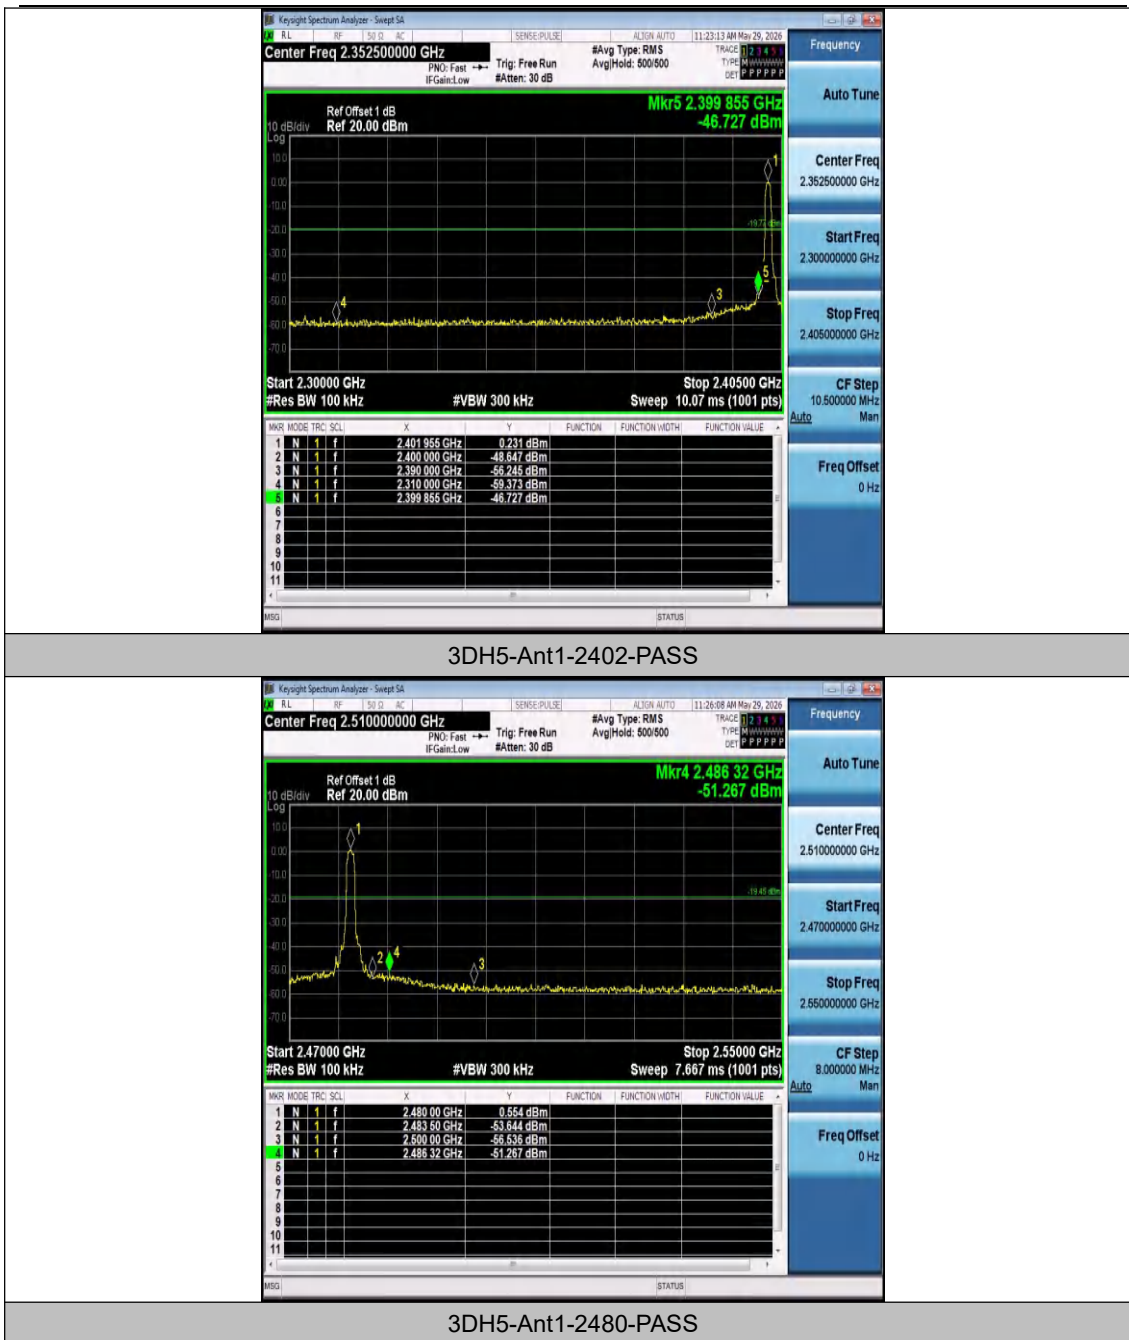

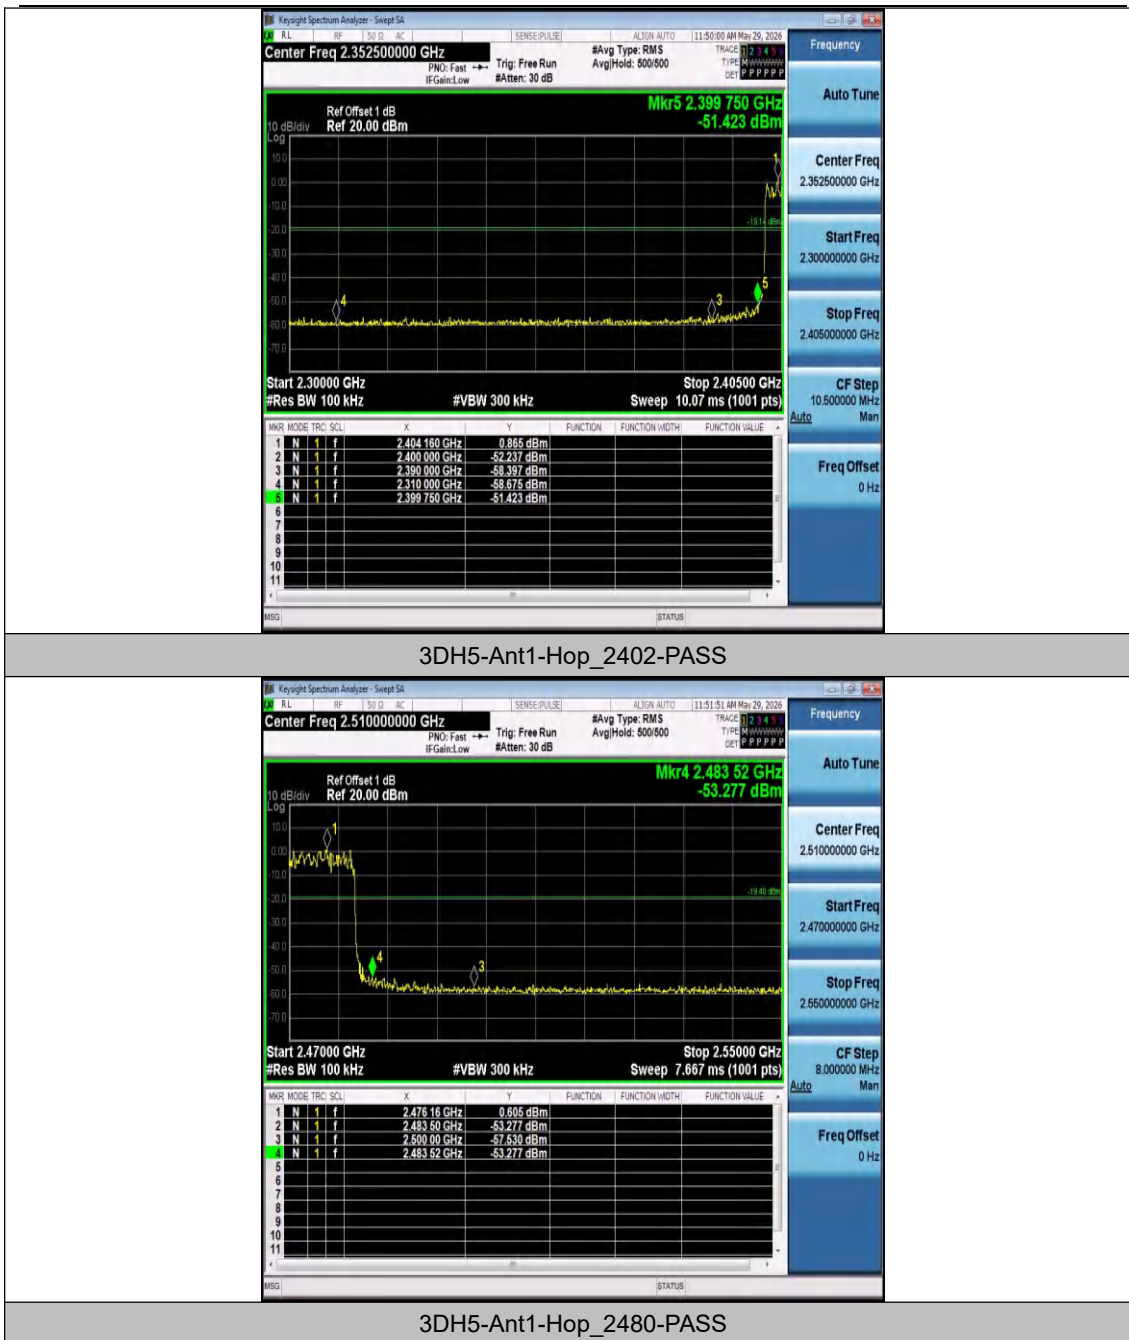

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix H: Conducted Spurious Emission

Test Result

Test Mode	Antenna	Frequency[MHz]	Freq. Range [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	2402	0~Reference	5.11	5.11	---	PASS
DH5	Ant1	2402	30~1000	5.11	-68.57	≤-14.89	PASS
DH5	Ant1	2402	1000~26500	5.11	-35.46	≤-14.89	PASS
DH5	Ant1	2441	0~Reference	5.18	5.18	---	PASS
DH5	Ant1	2441	30~1000	5.18	-68.67	≤-14.82	PASS
DH5	Ant1	2441	1000~26500	5.18	-35.88	≤-14.82	PASS
DH5	Ant1	2480	0~Reference	5.38	5.38	---	PASS
DH5	Ant1	2480	30~1000	5.38	-67.96	≤-14.62	PASS
DH5	Ant1	2480	1000~26500	5.38	-35.47	≤-14.62	PASS
2DH5	Ant1	2402	0~Reference	-0.31	-0.31	---	PASS
2DH5	Ant1	2402	30~1000	-0.31	-67.81	≤-20.31	PASS
2DH5	Ant1	2402	1000~26500	-0.31	-35.59	≤-20.31	PASS
2DH5	Ant1	2441	0~Reference	-0.14	-0.14	---	PASS
2DH5	Ant1	2441	30~1000	-0.14	-68.55	≤-20.14	PASS
2DH5	Ant1	2441	1000~26500	-0.14	-36.16	≤-20.14	PASS
2DH5	Ant1	2480	0~Reference	-0.03	-0.03	---	PASS
2DH5	Ant1	2480	30~1000	-0.03	-68.71	≤-20.03	PASS
2DH5	Ant1	2480	1000~26500	-0.03	-35.81	≤-20.03	PASS
3DH5	Ant1	2402	0~Reference	-0.27	-0.27	---	PASS
3DH5	Ant1	2402	30~1000	-0.27	-68.64	≤-20.27	PASS
3DH5	Ant1	2402	1000~26500	-0.27	-35.25	≤-20.27	PASS
3DH5	Ant1	2441	0~Reference	-0.13	-0.13	---	PASS
3DH5	Ant1	2441	30~1000	-0.13	-67.77	≤-20.13	PASS
3DH5	Ant1	2441	1000~26500	-0.13	-35.46	≤-20.13	PASS
3DH5	Ant1	2480	0~Reference	0.07	0.07	---	PASS
3DH5	Ant1	2480	30~1000	0.07	-68.65	≤-19.93	PASS
3DH5	Ant1	2480	1000~26500	0.07	-35.77	≤-19.93	PASS

Remark:Regarding the spurious emissions from 30MHz to 26.5GHz, the cable loss have been set in the 'Input Correction' of the Spectrum Analyzer during the test.


Test Graphs

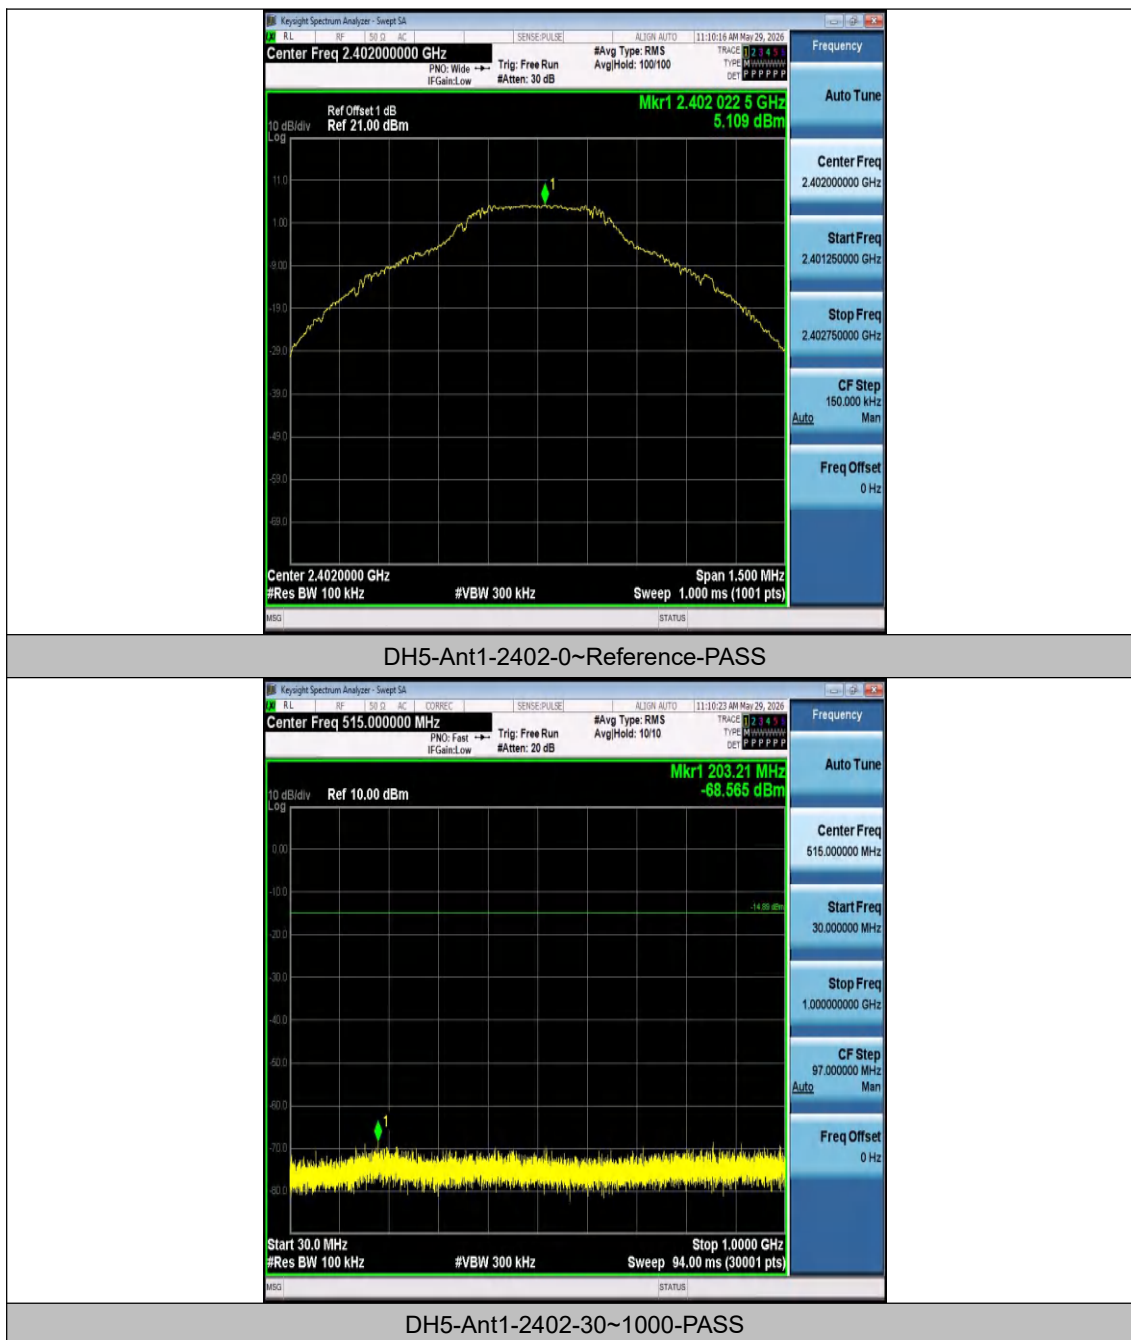

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

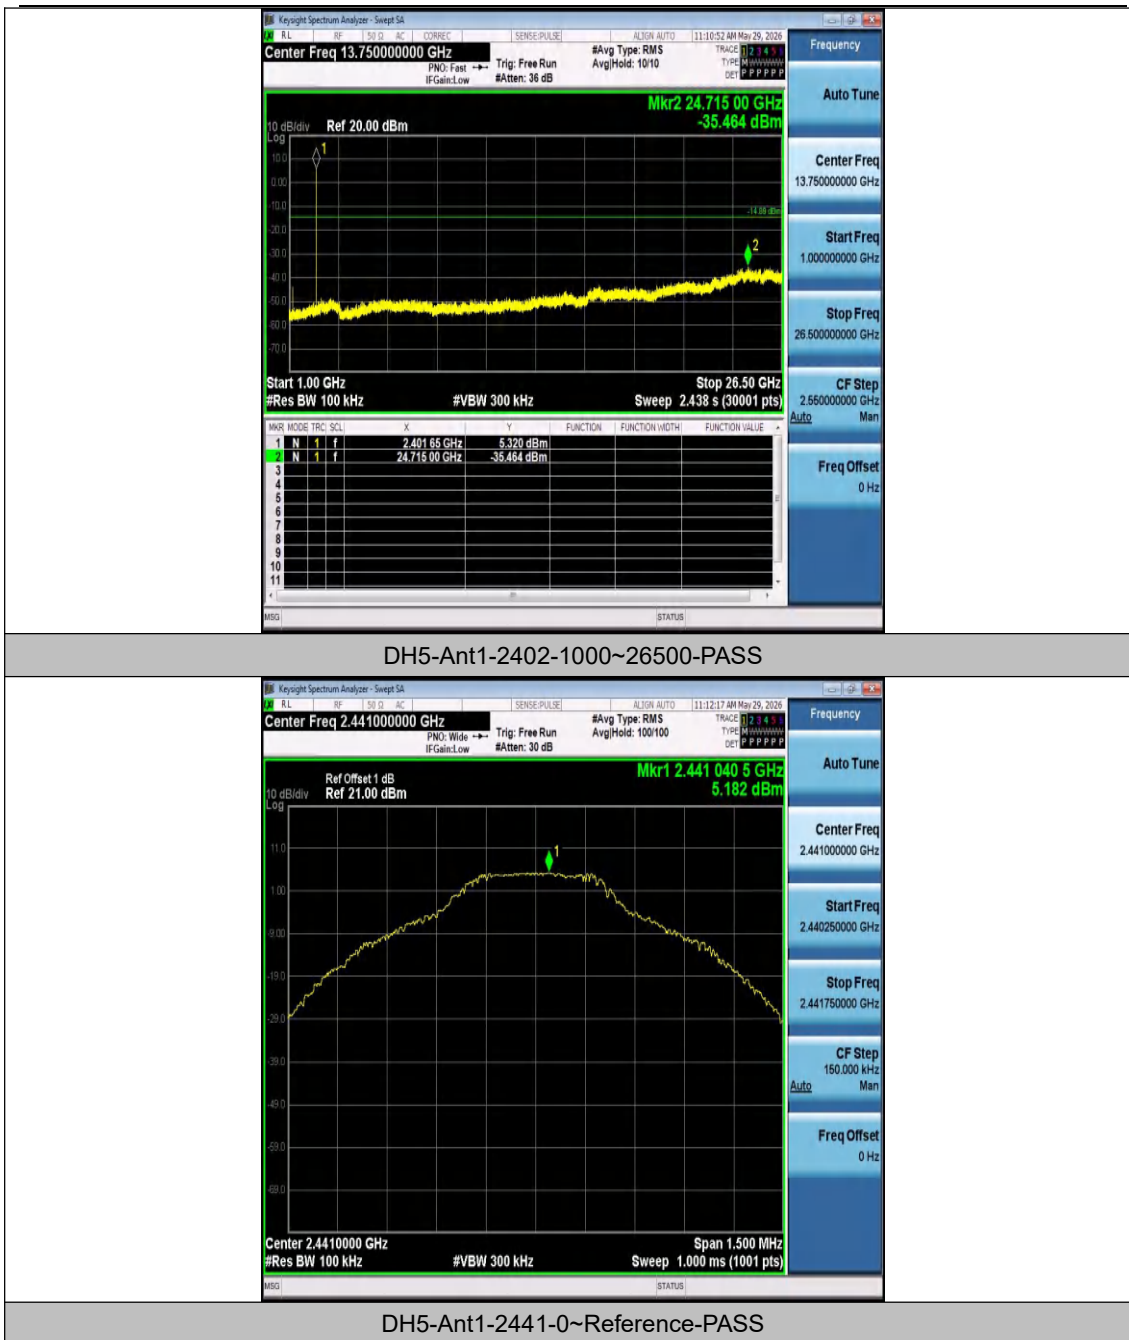

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

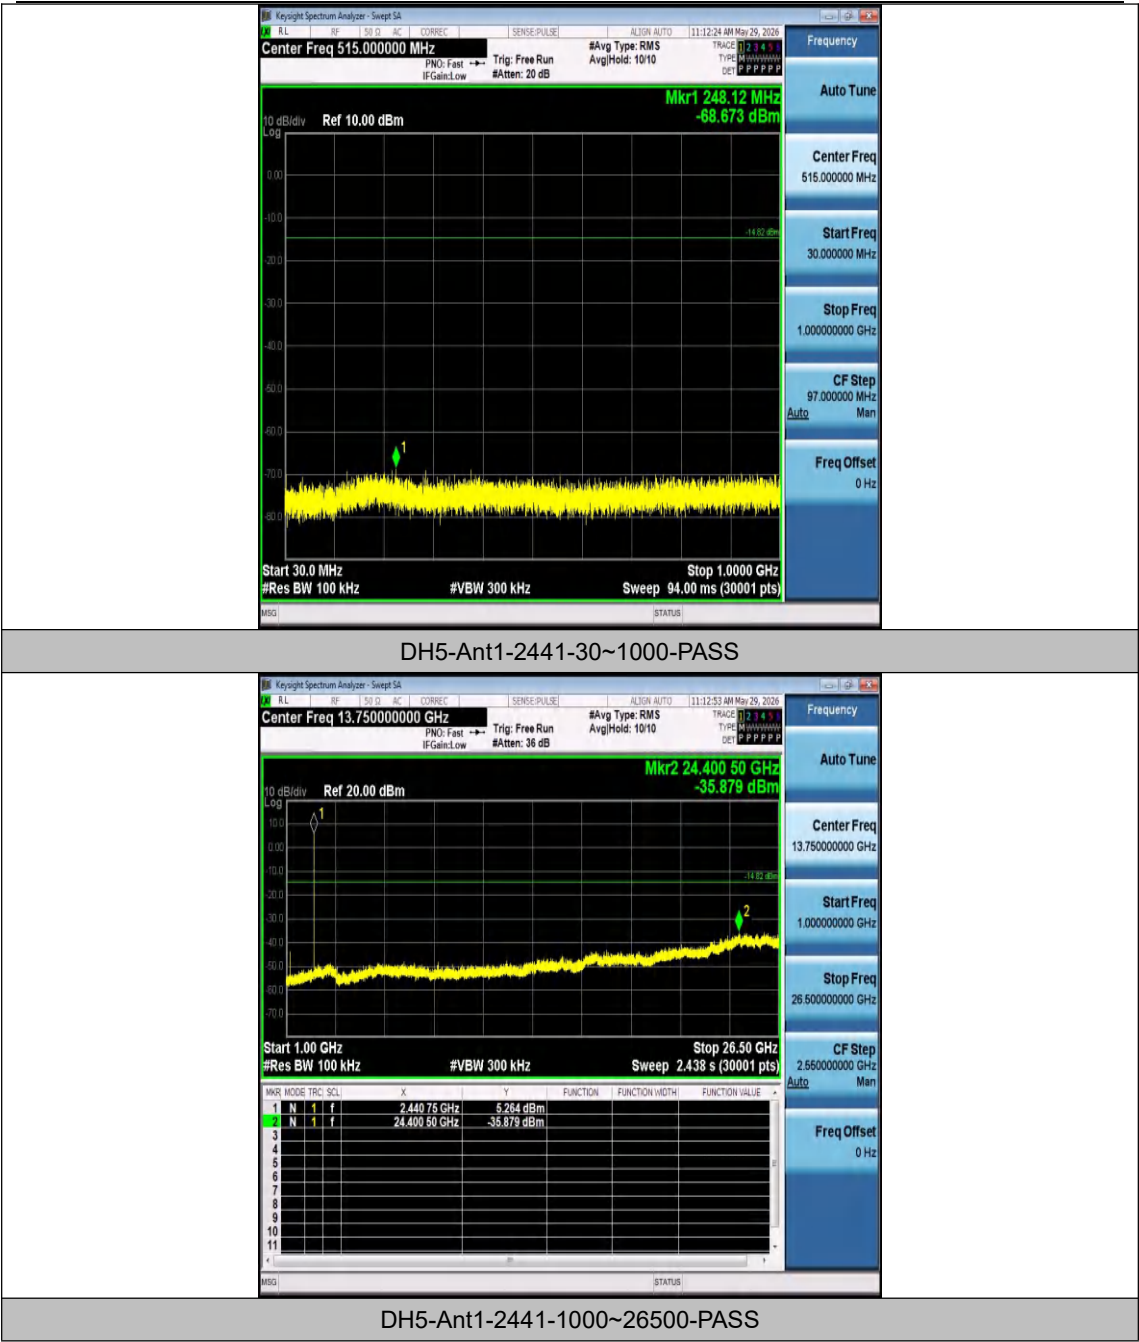

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

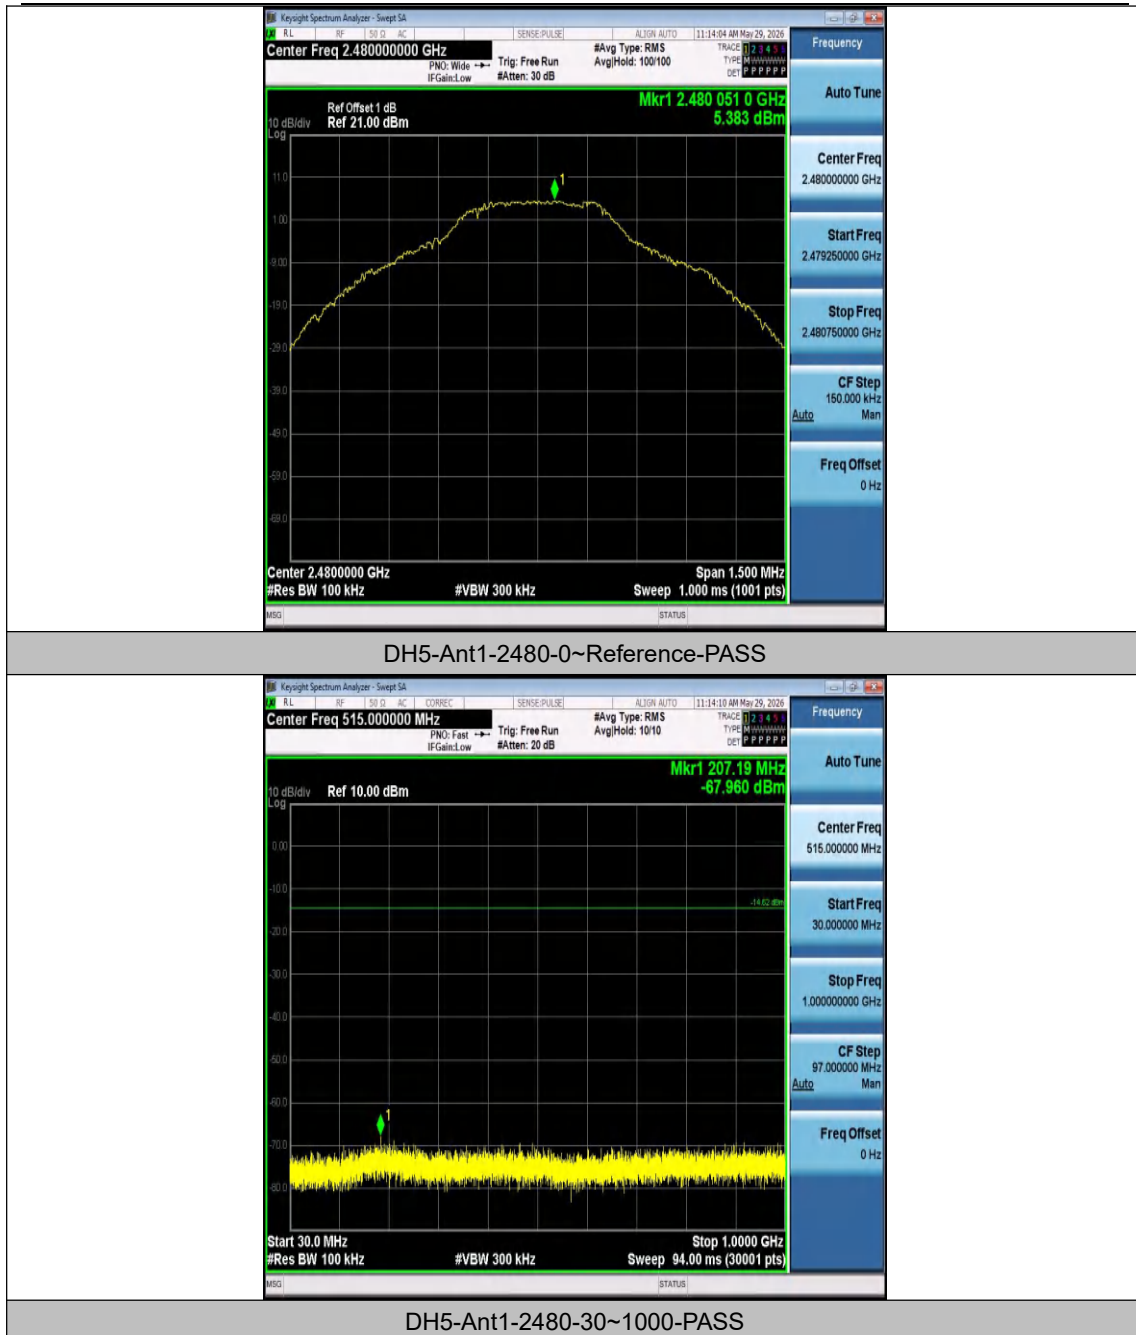

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

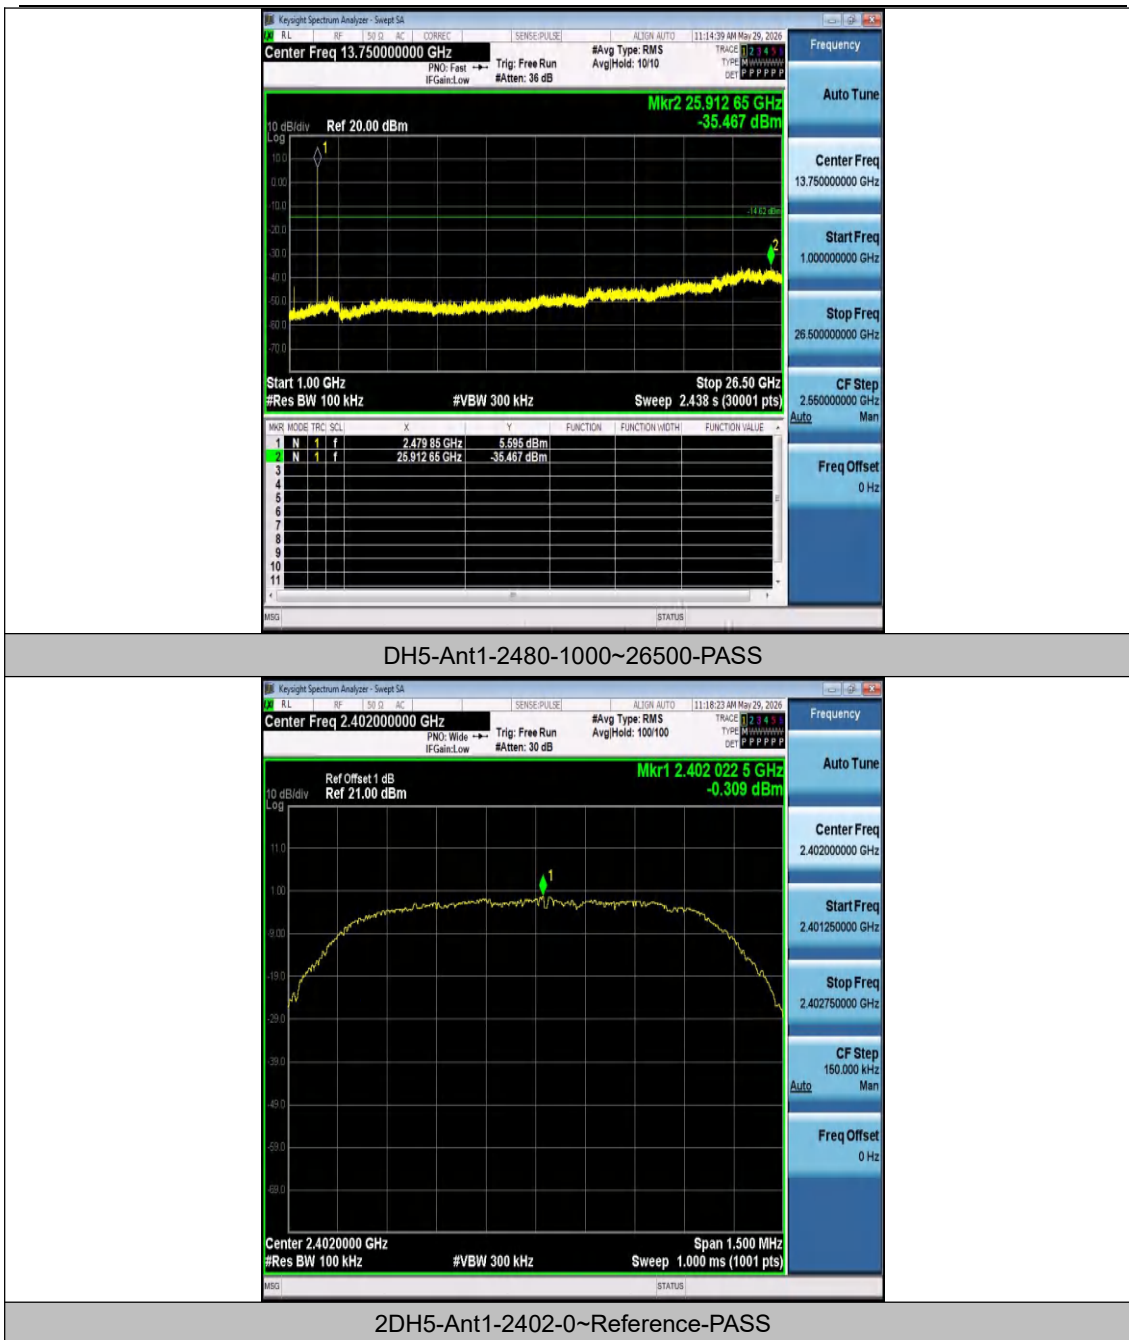


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

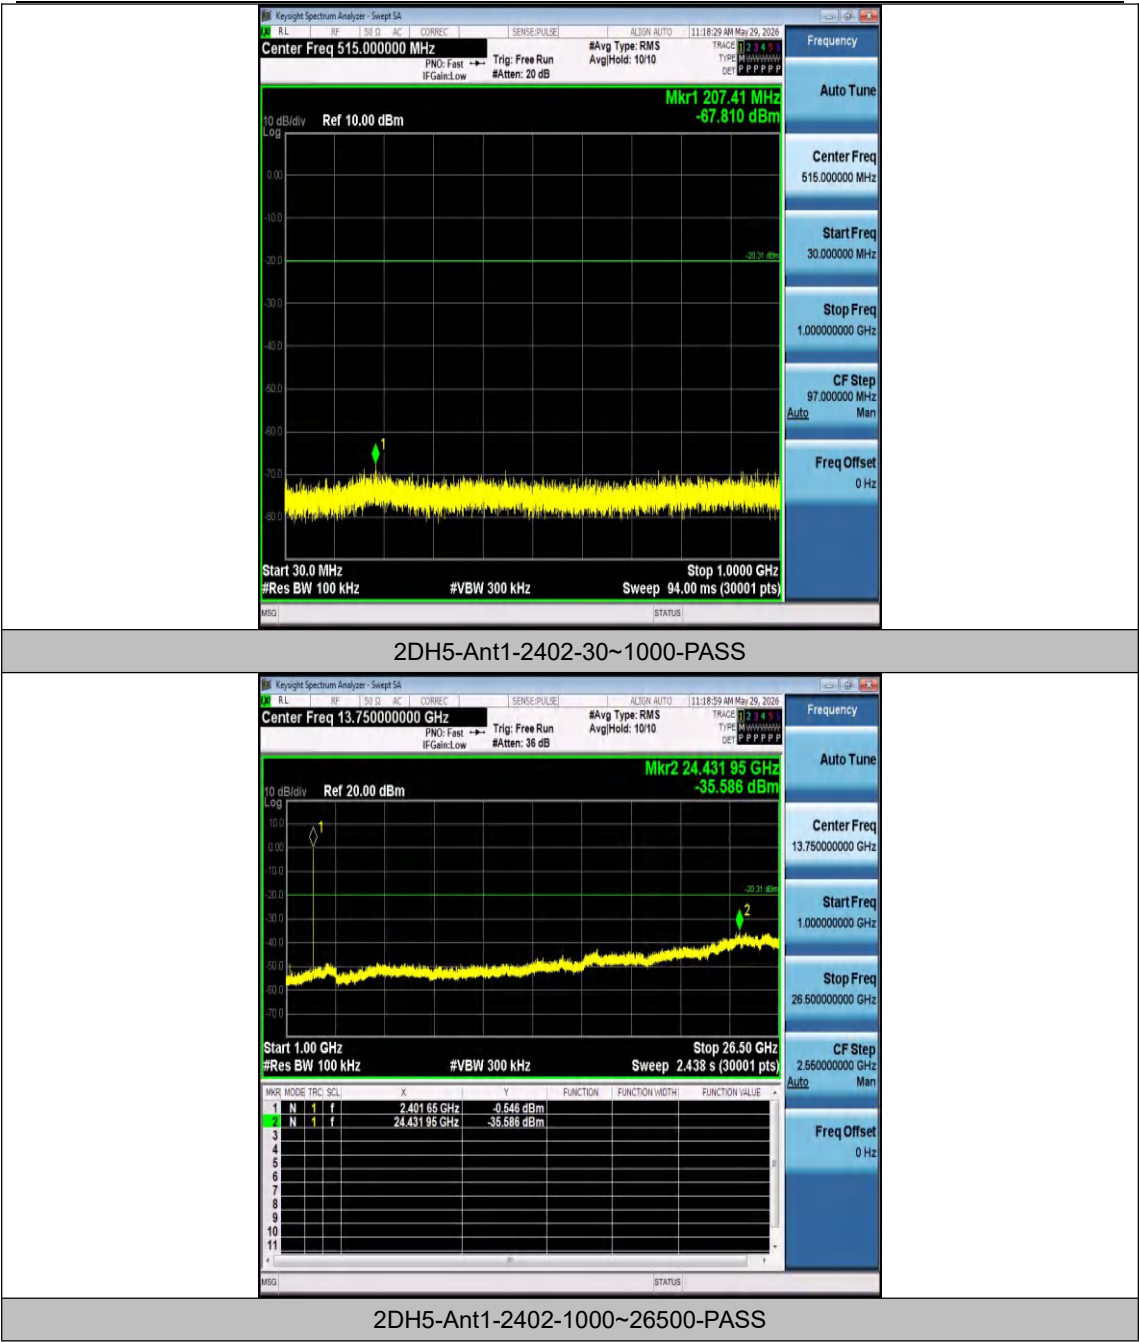


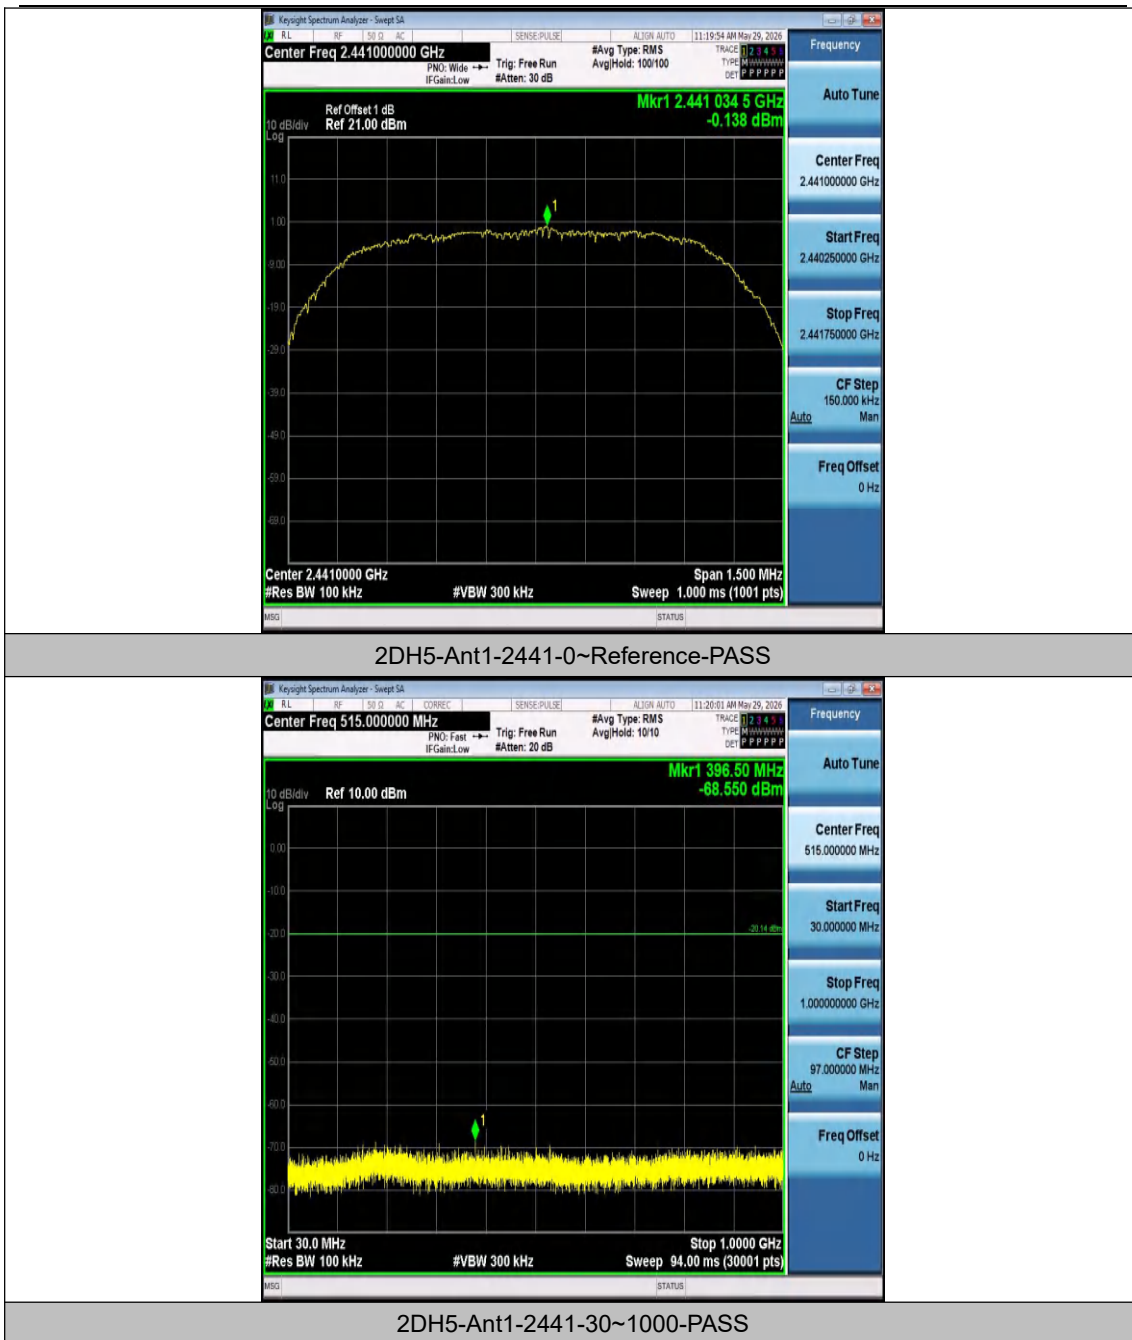

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

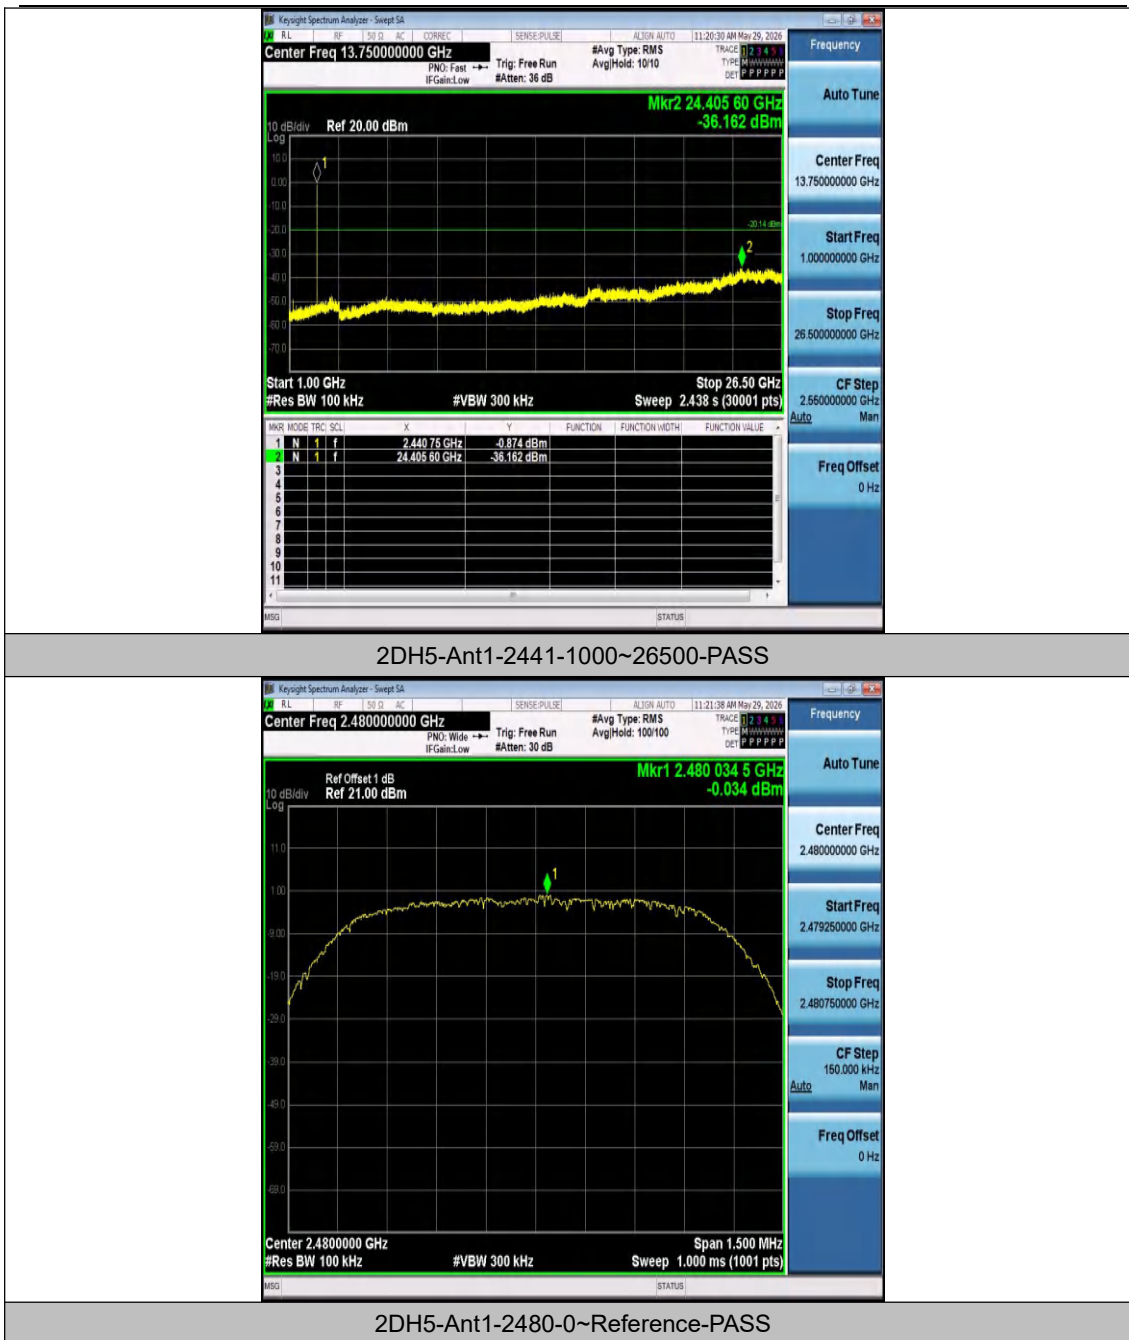


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

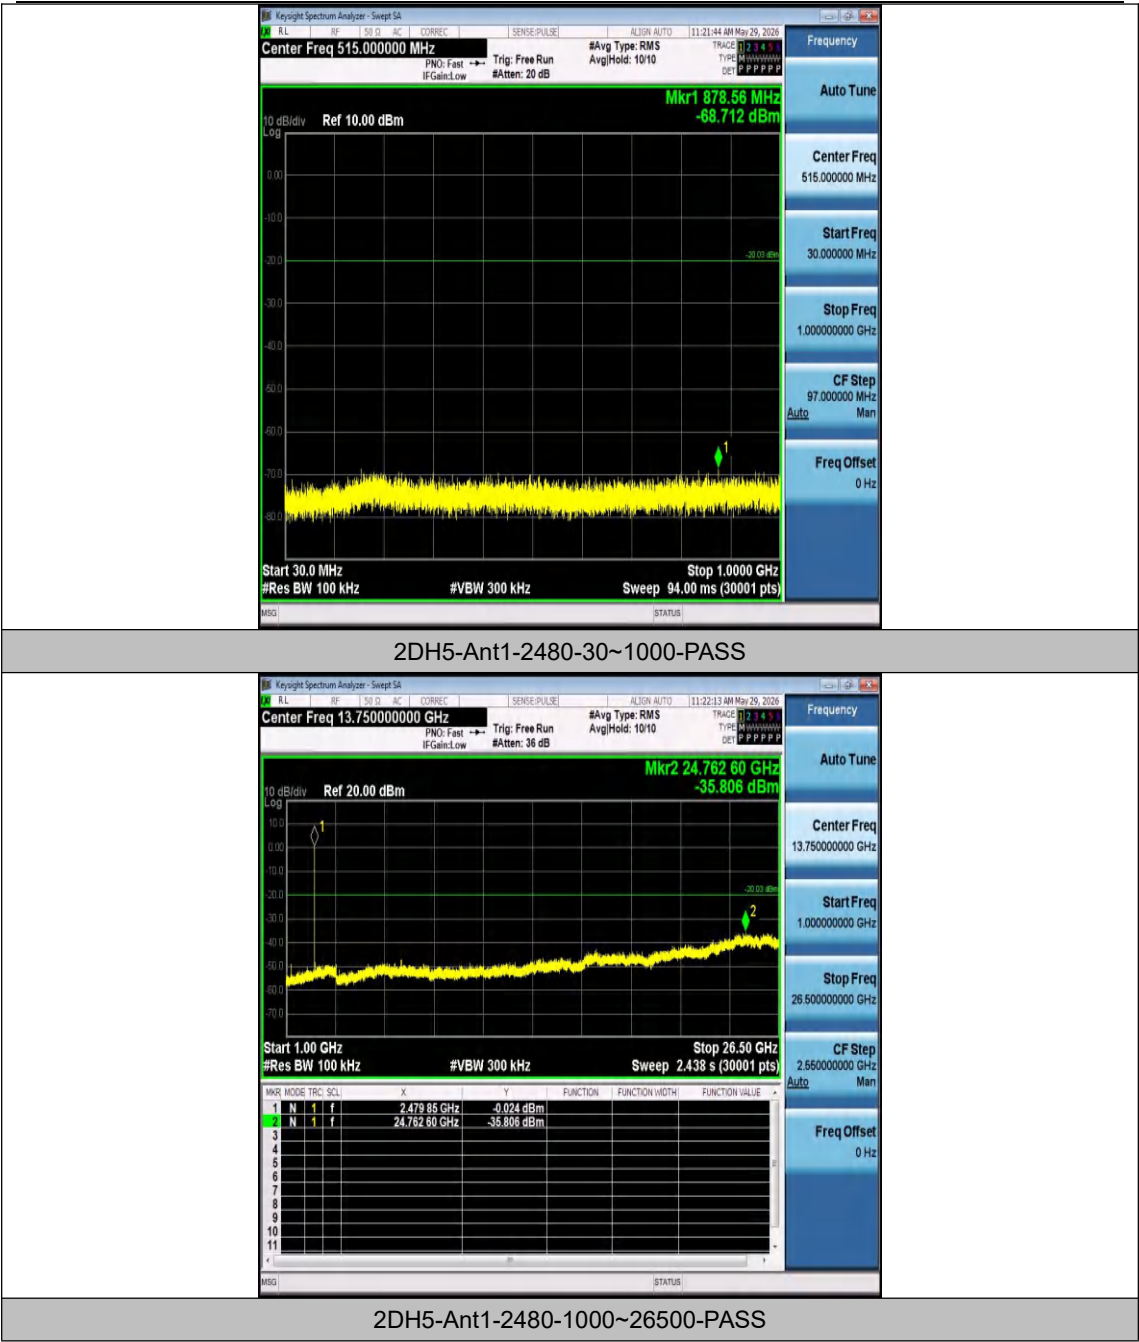


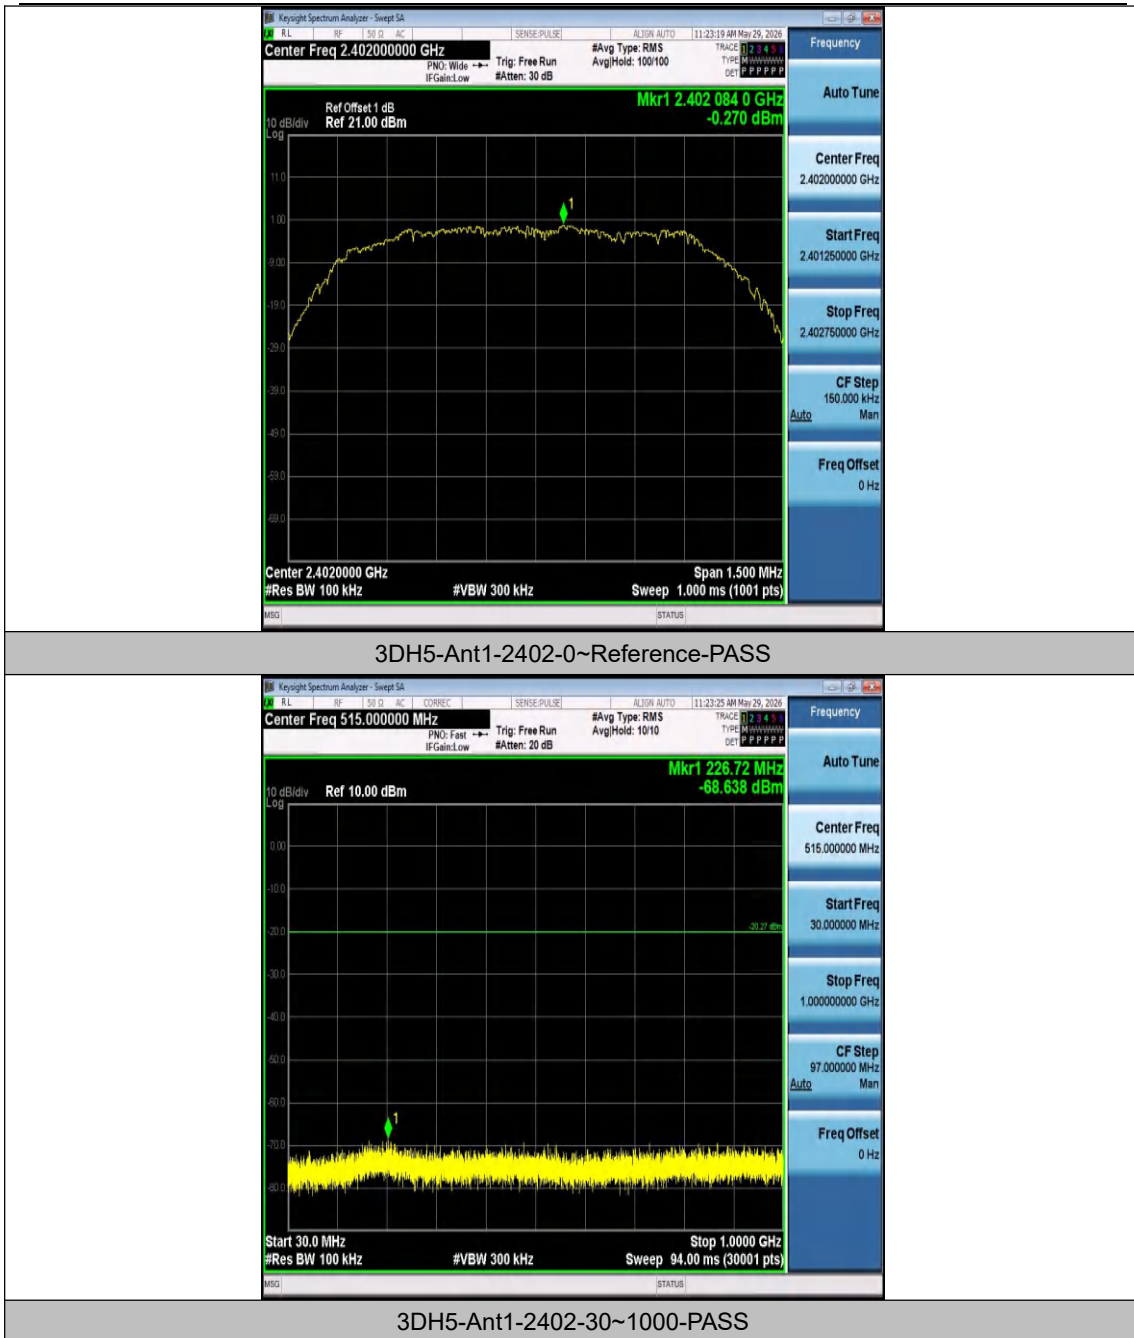

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

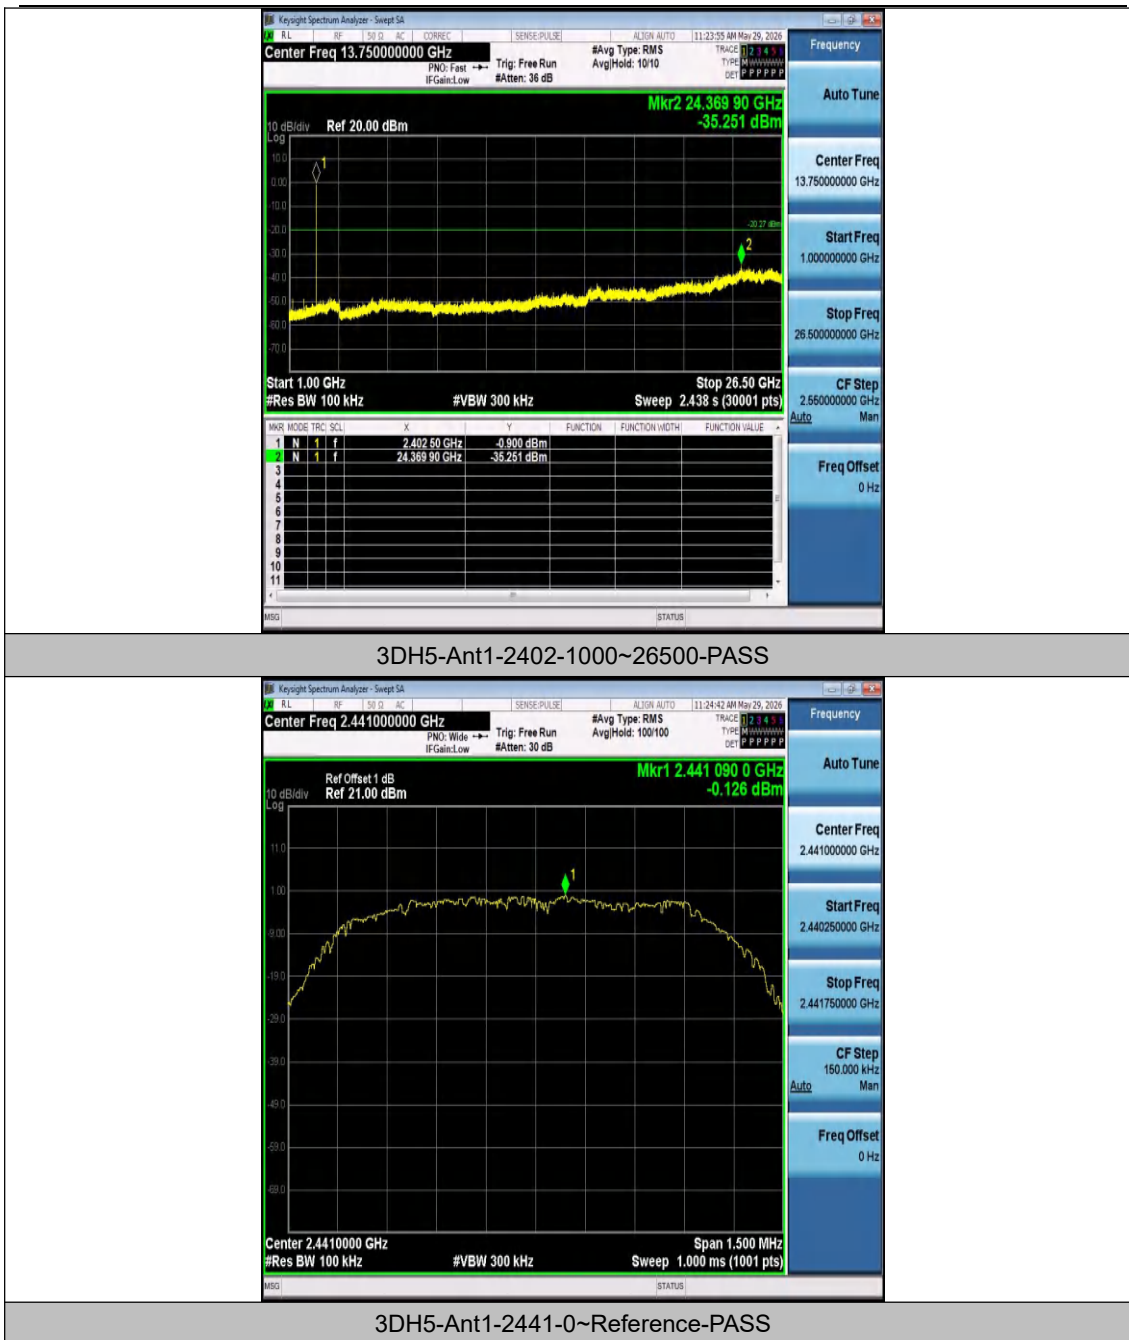


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

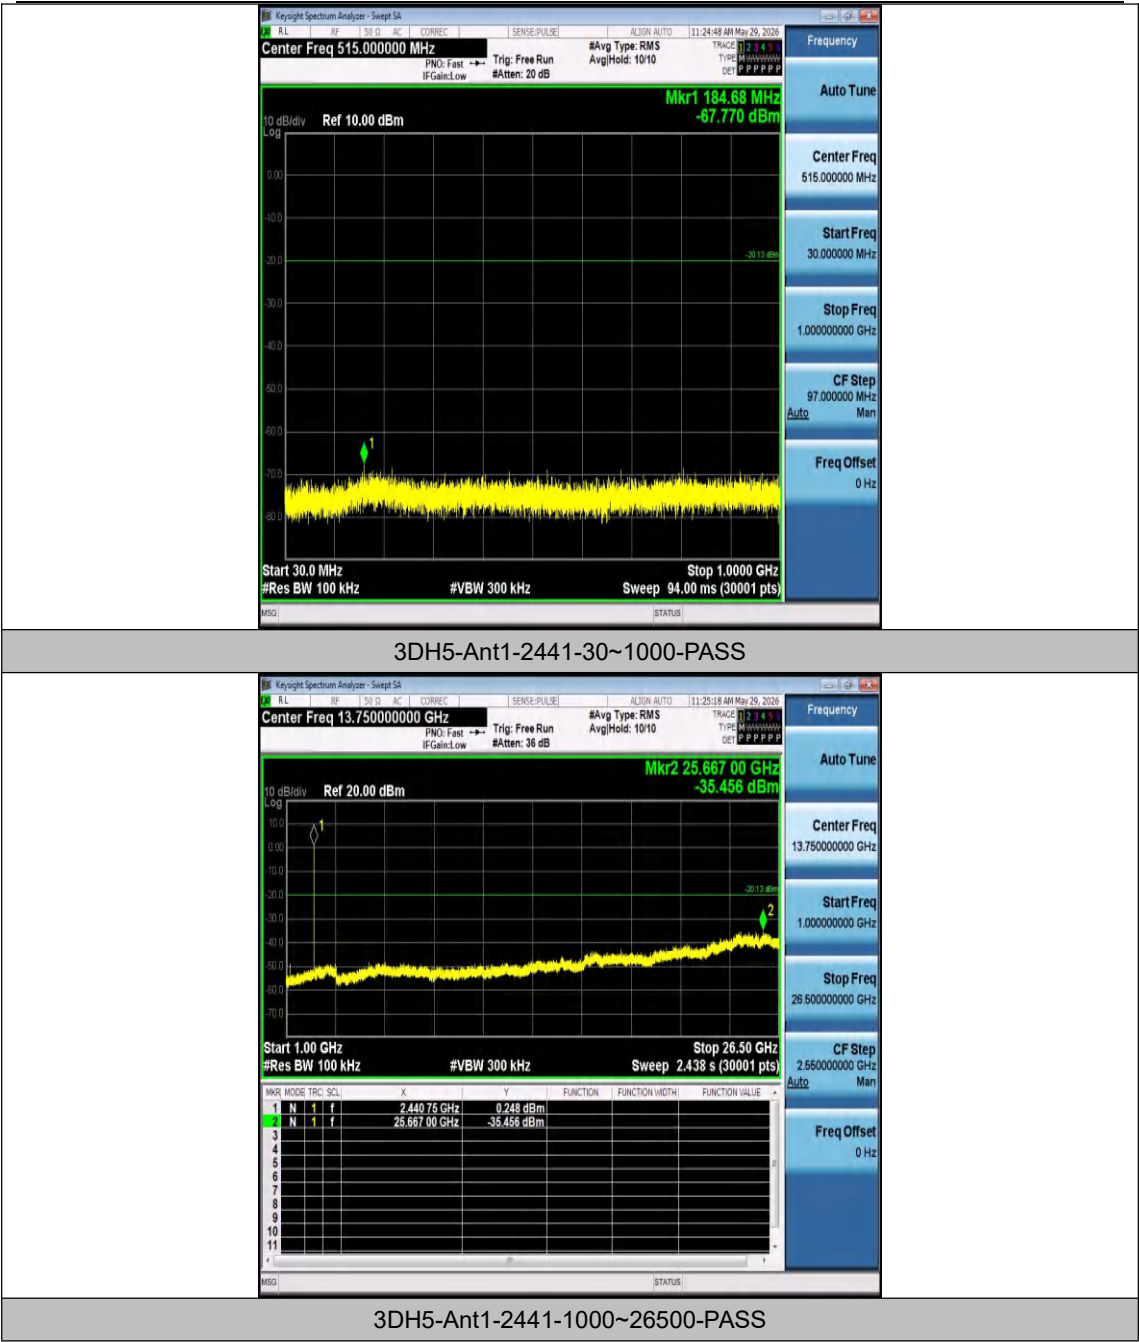


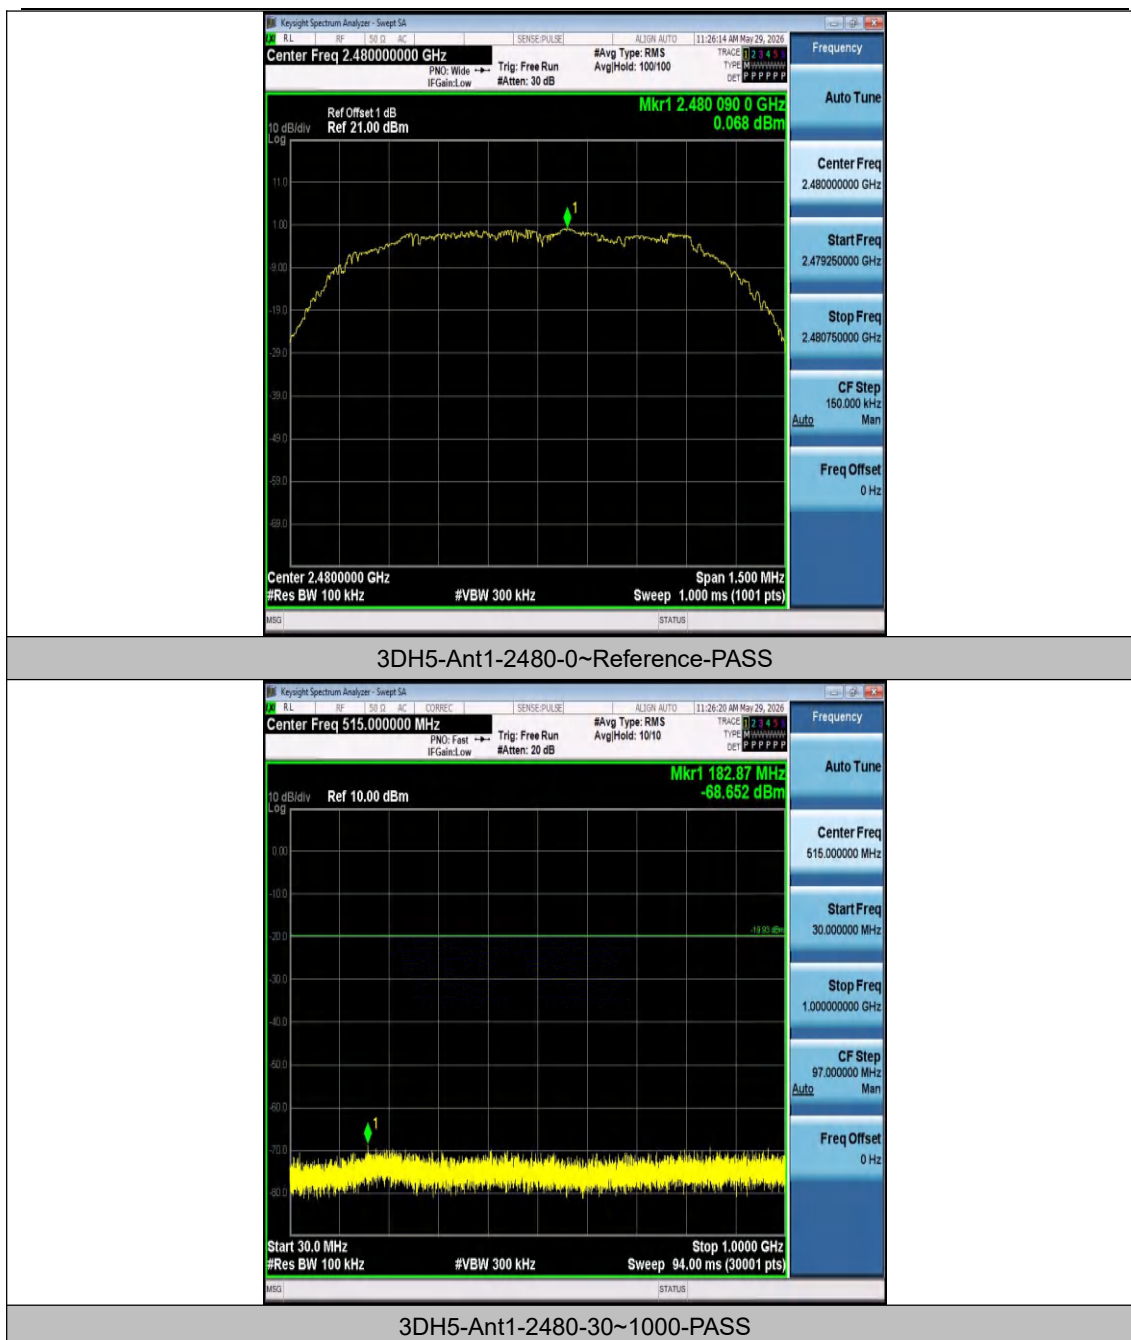

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

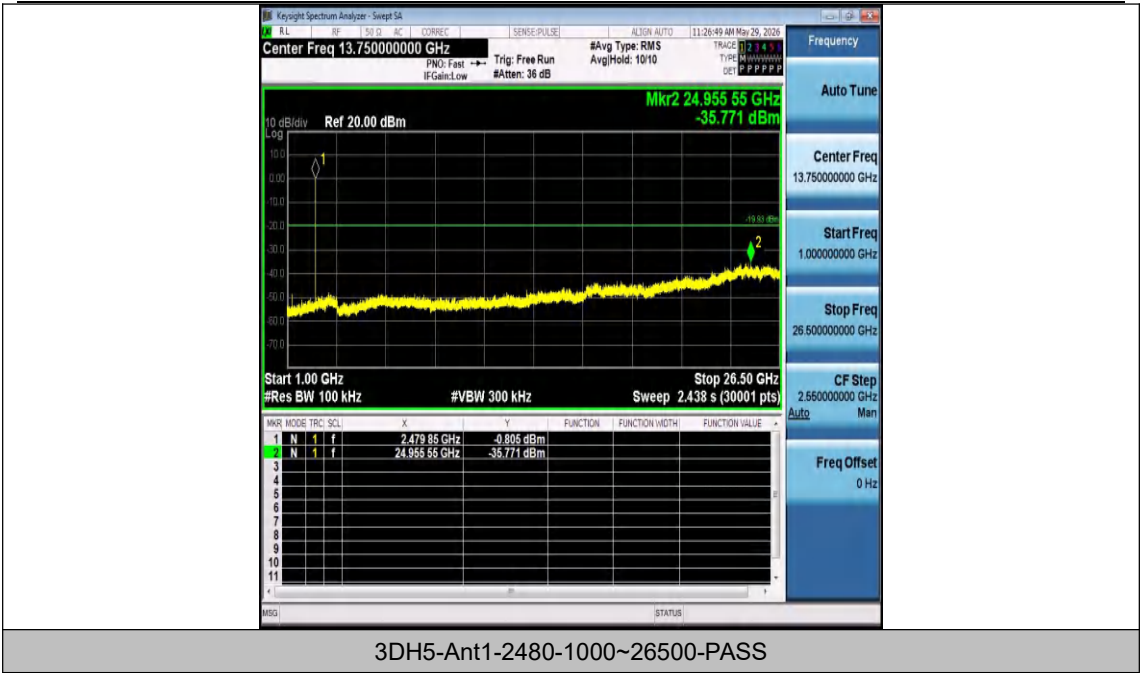

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix I: Duty Cycle

Test Result

Test Mode	Antenna	Frequency[MHz]	ON Time [ms]	Period [ms]	Duty Cycle [%]	Duty Cycle Factor[dB]
DH5	Ant1	2402	100.00	100.00	100.00	0.00
DH5	Ant1	2441	100.00	100.00	100.00	0.00
DH5	Ant1	2480	100.00	100.00	100.00	0.00
2DH5	Ant1	2402	100.00	100.00	100.00	0.00
2DH5	Ant1	2441	100.00	100.00	100.00	0.00
2DH5	Ant1	2480	100.00	100.00	100.00	0.00
3DH5	Ant1	2402	100.00	100.00	100.00	0.00
3DH5	Ant1	2441	100.00	100.00	100.00	0.00
3DH5	Ant1	2480	100.00	100.00	100.00	0.00


Test Graphs

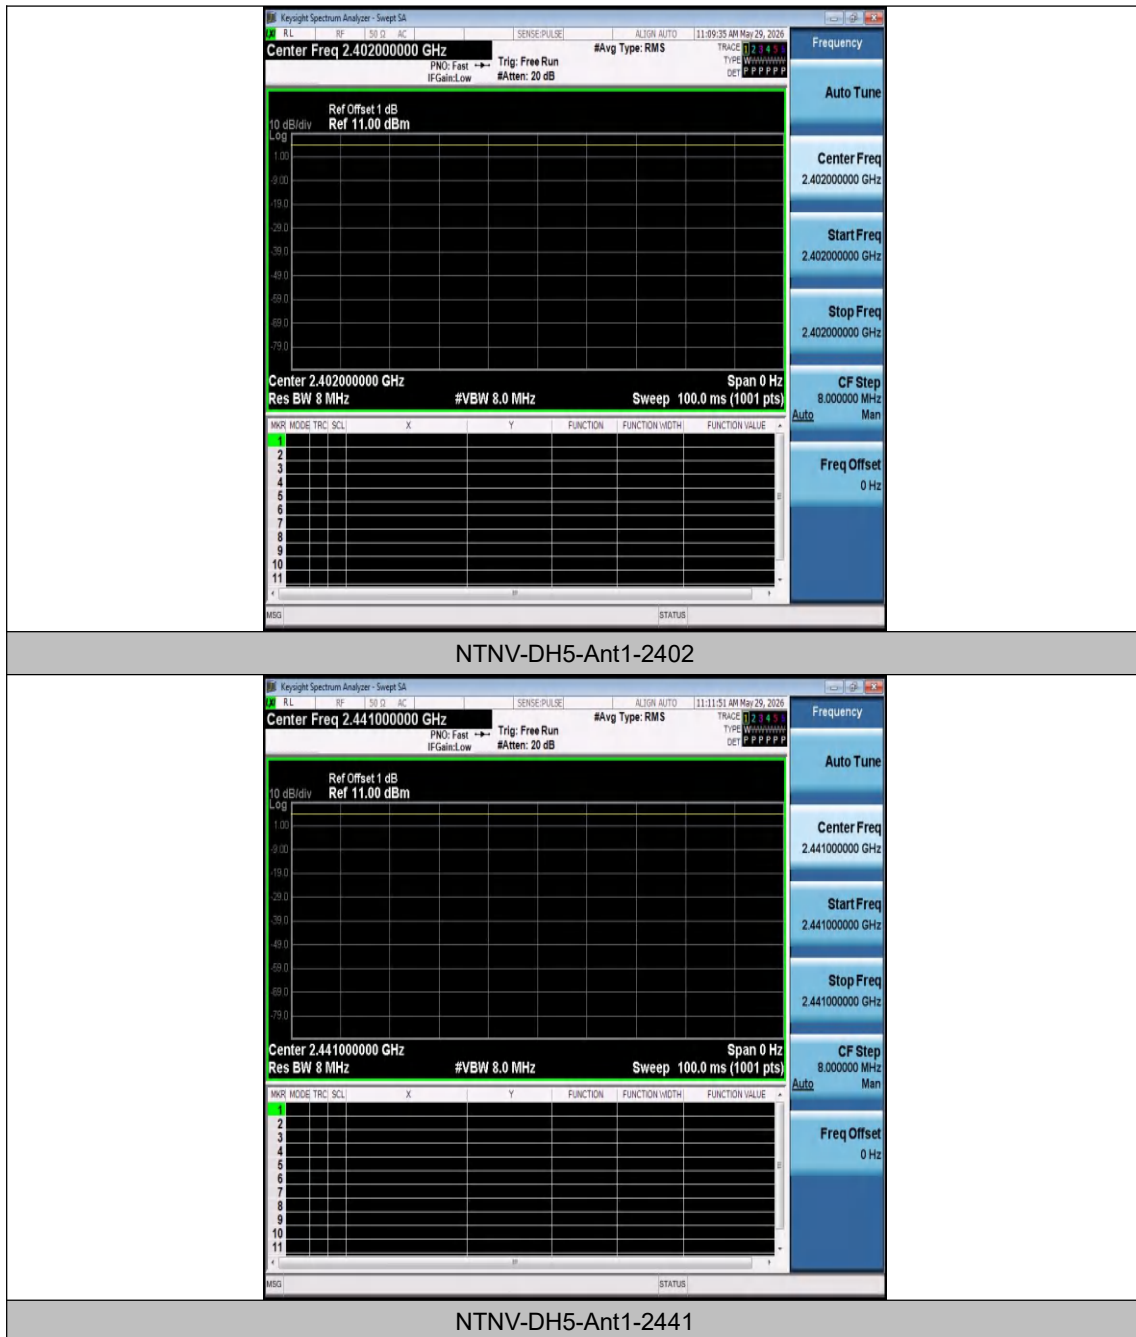

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

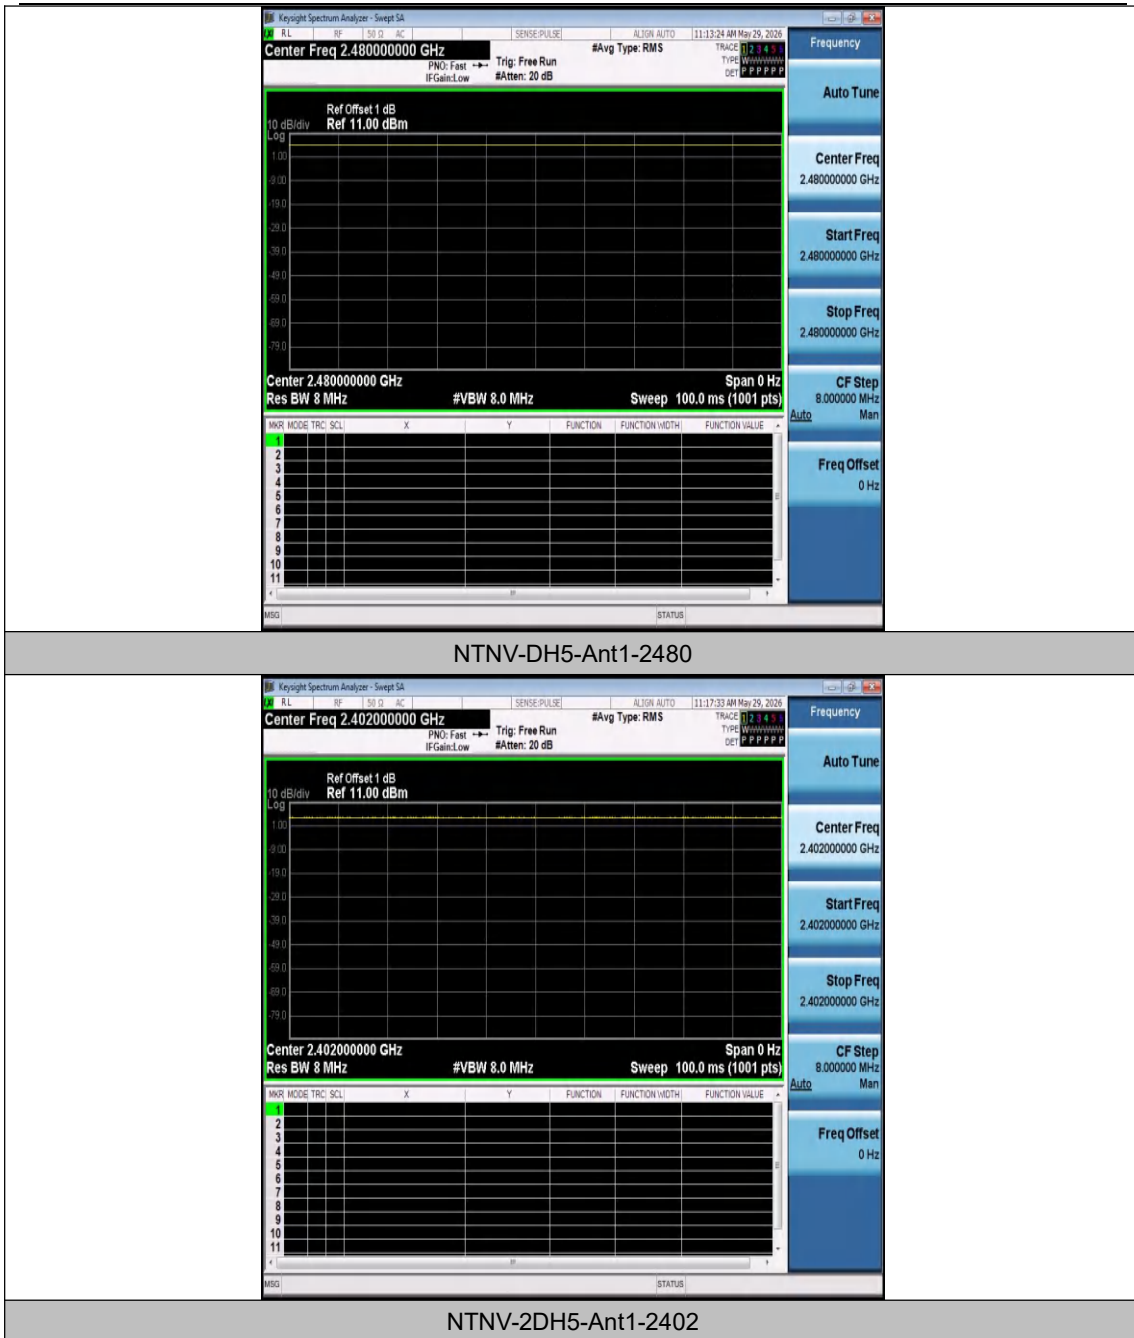


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

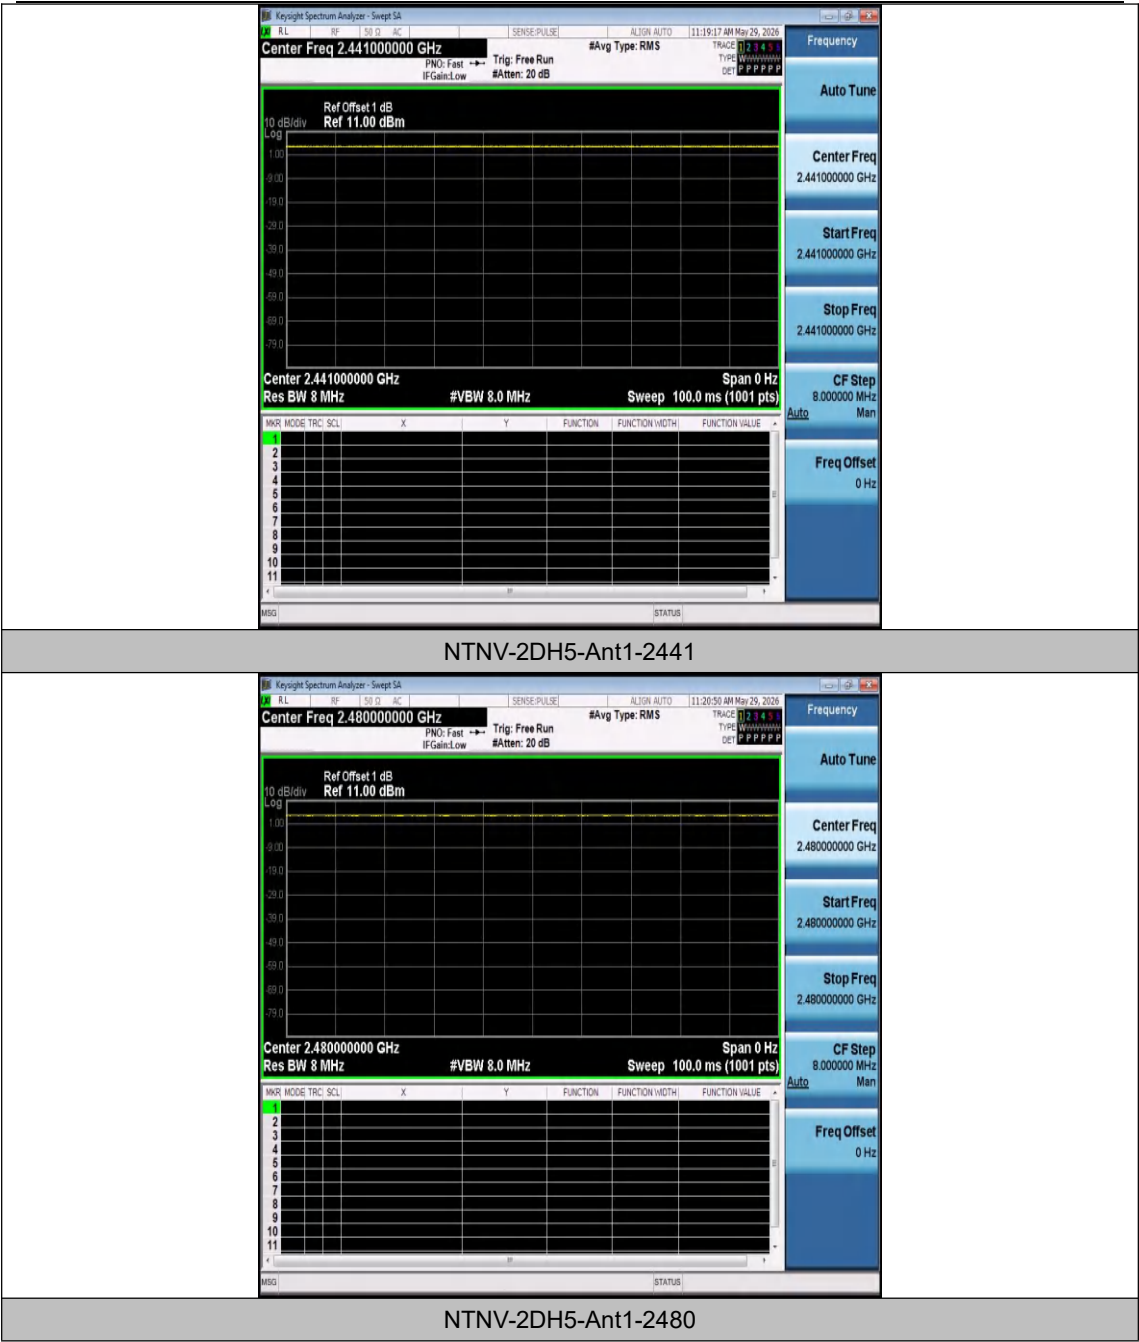


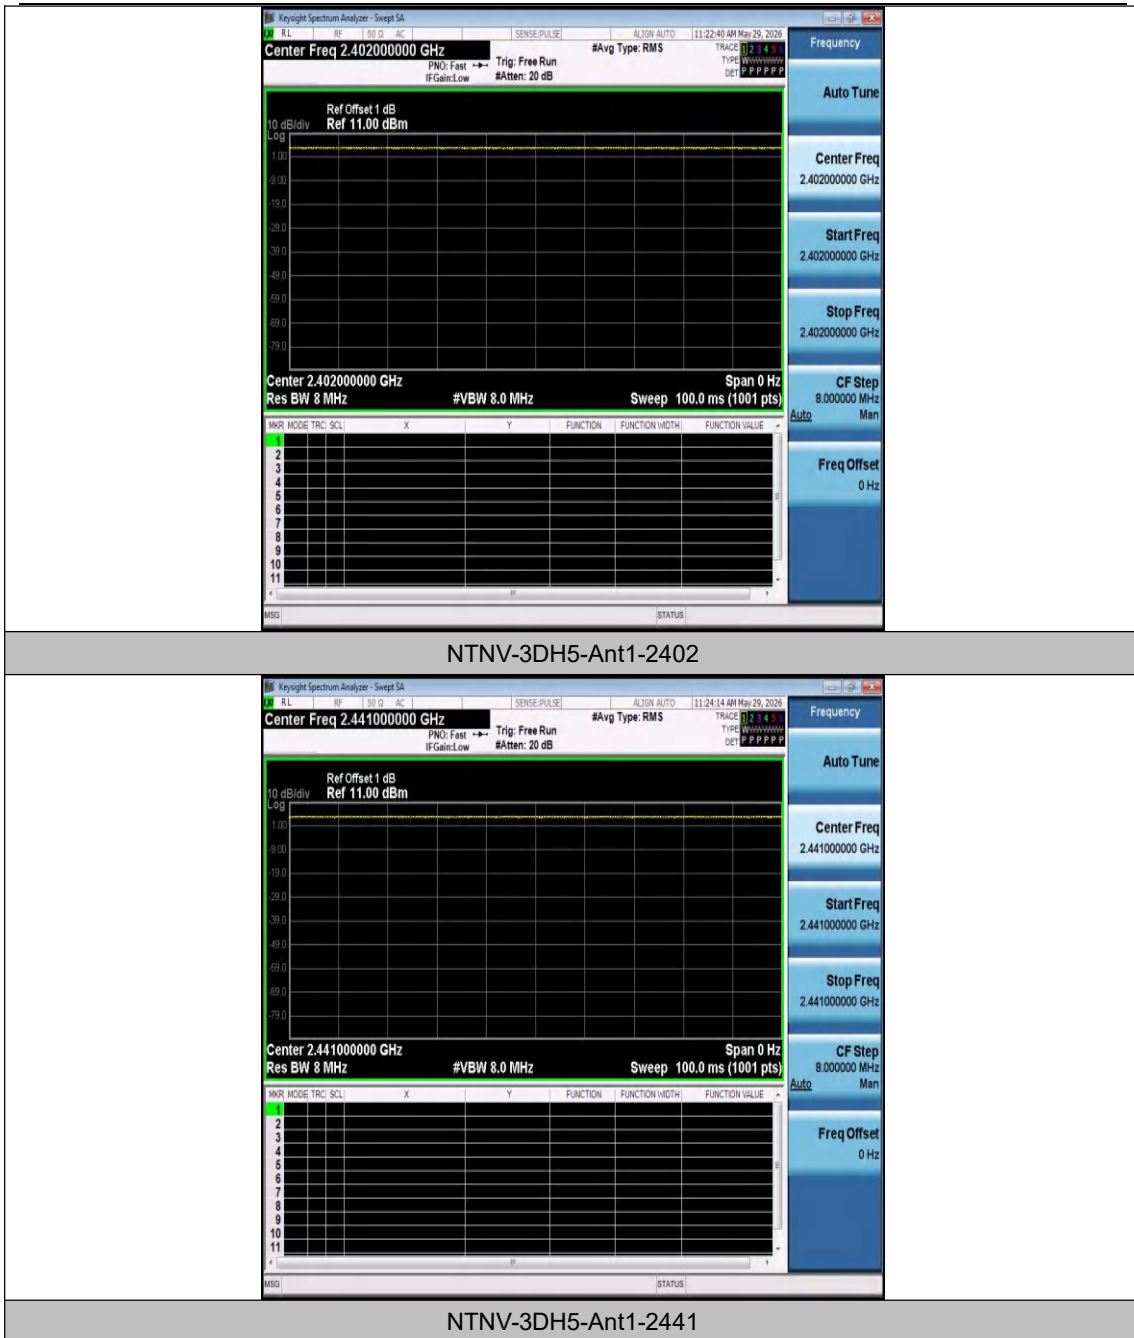

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

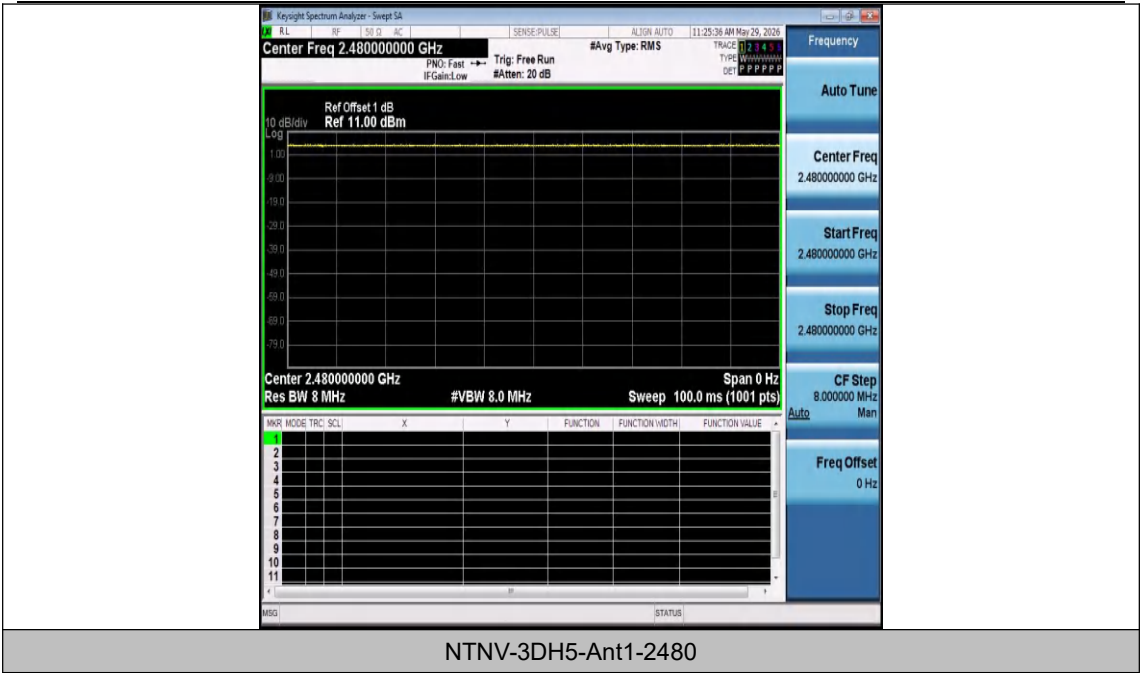

---End---