






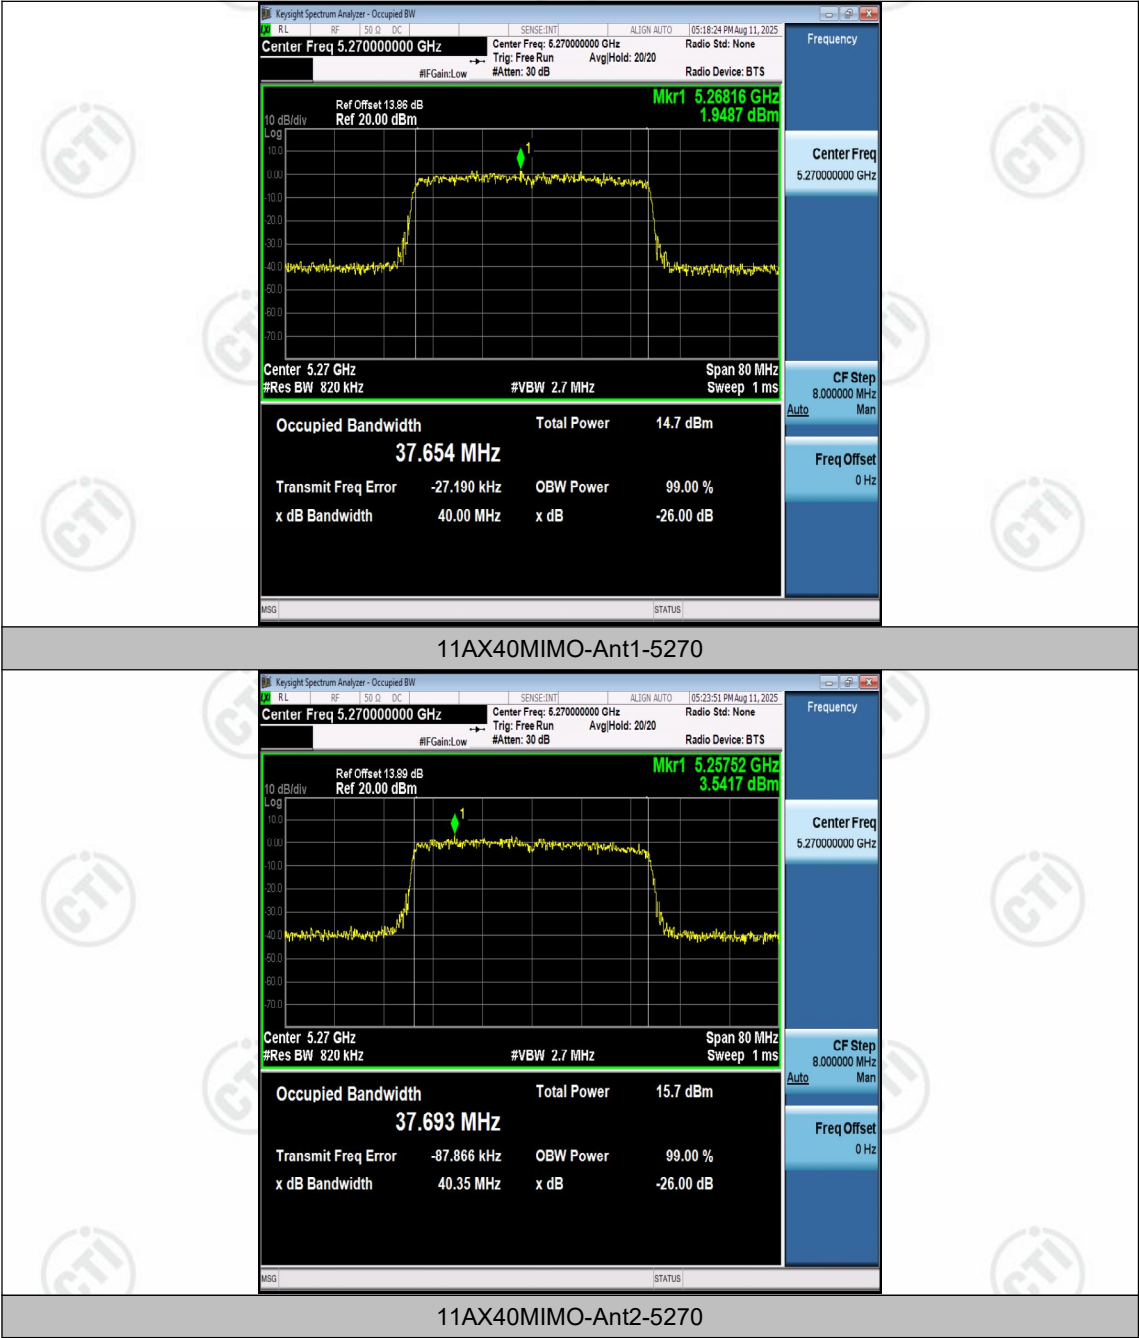


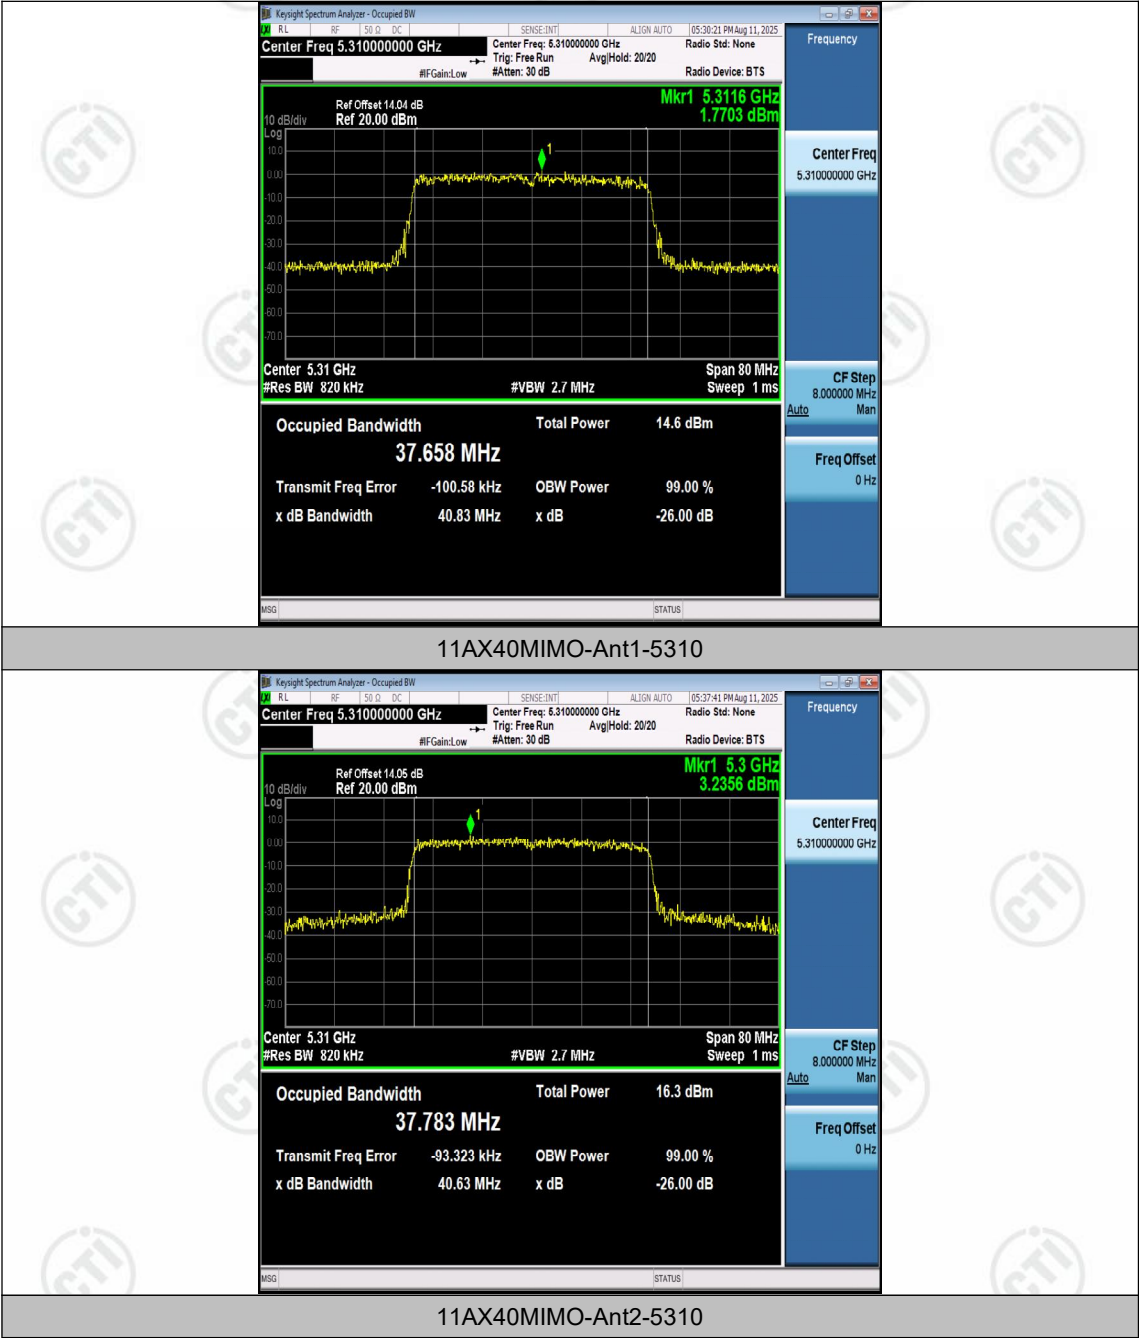


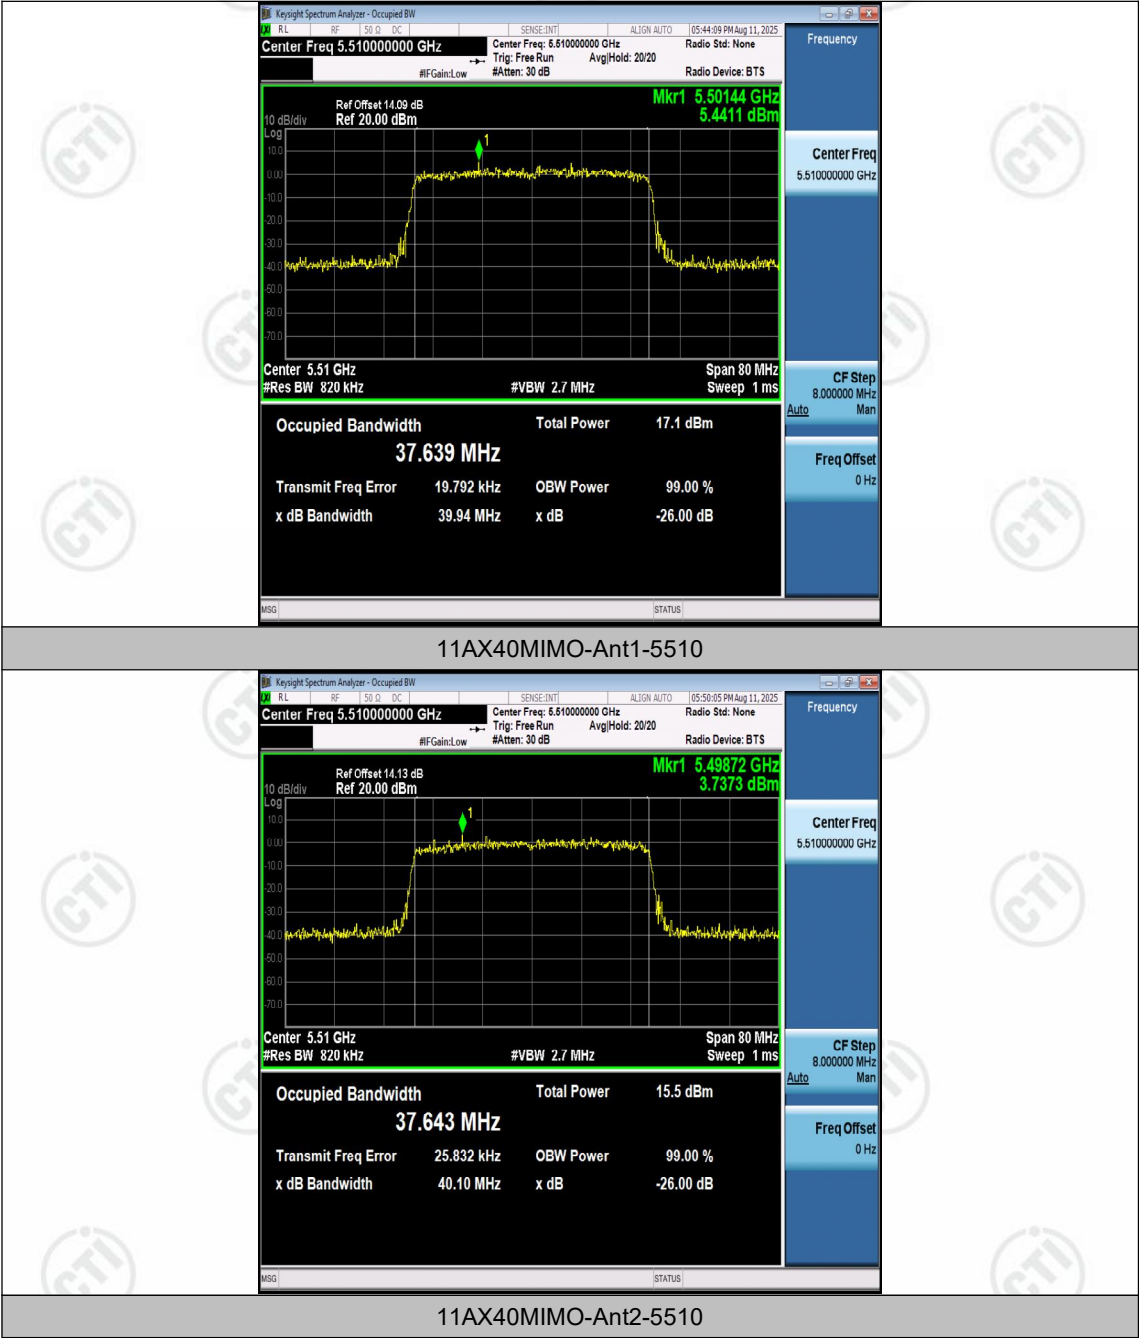


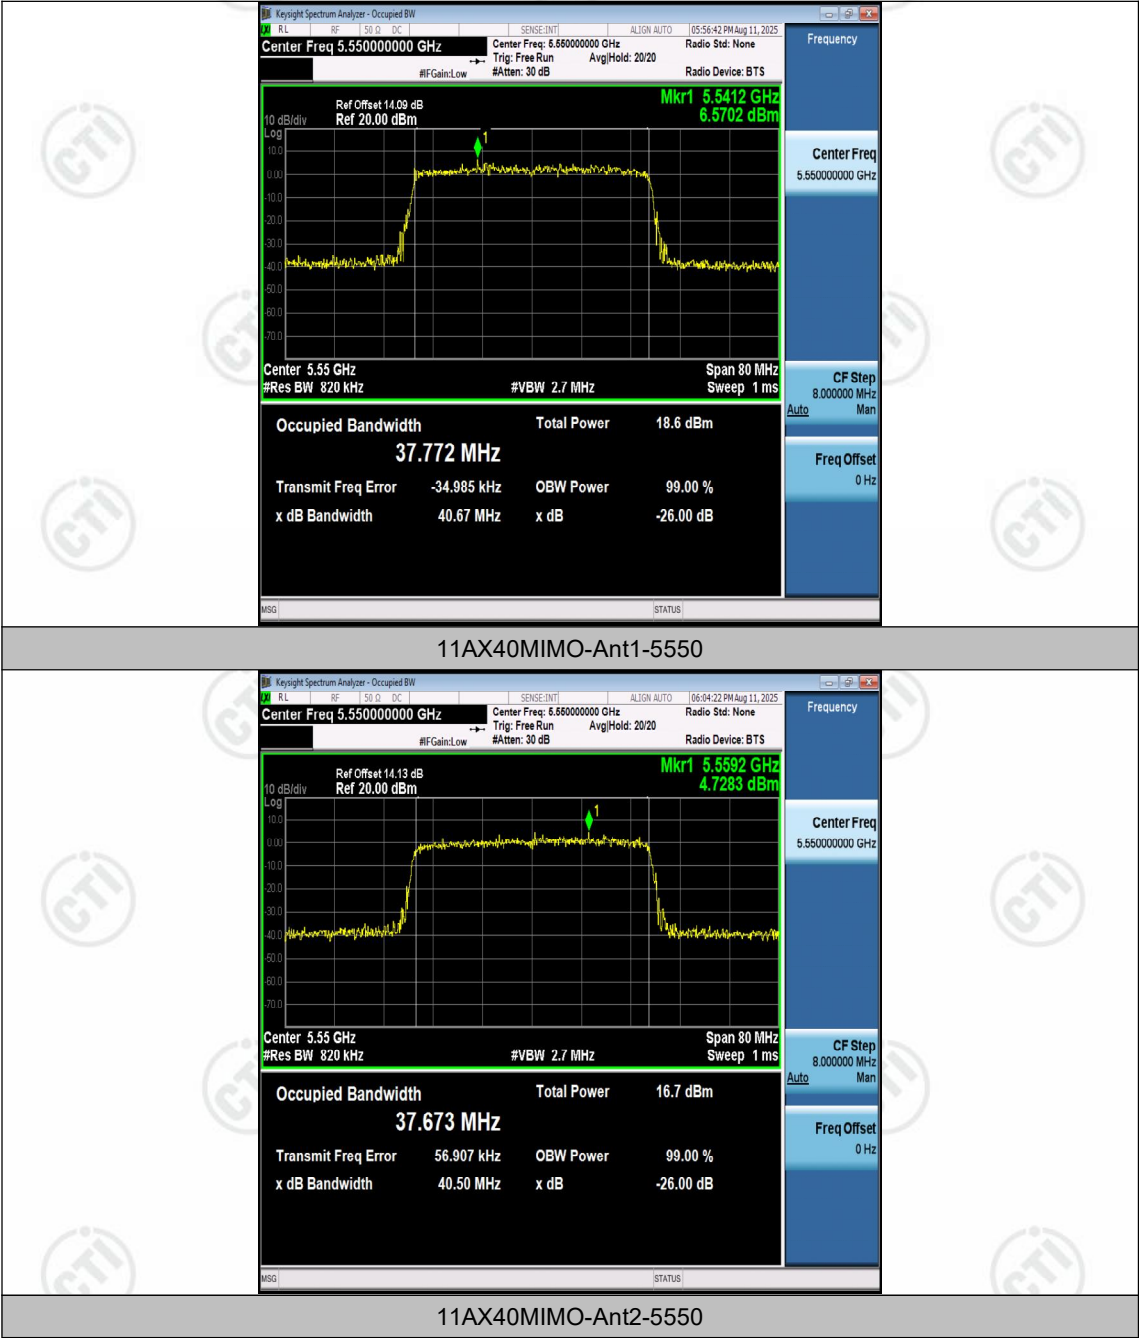


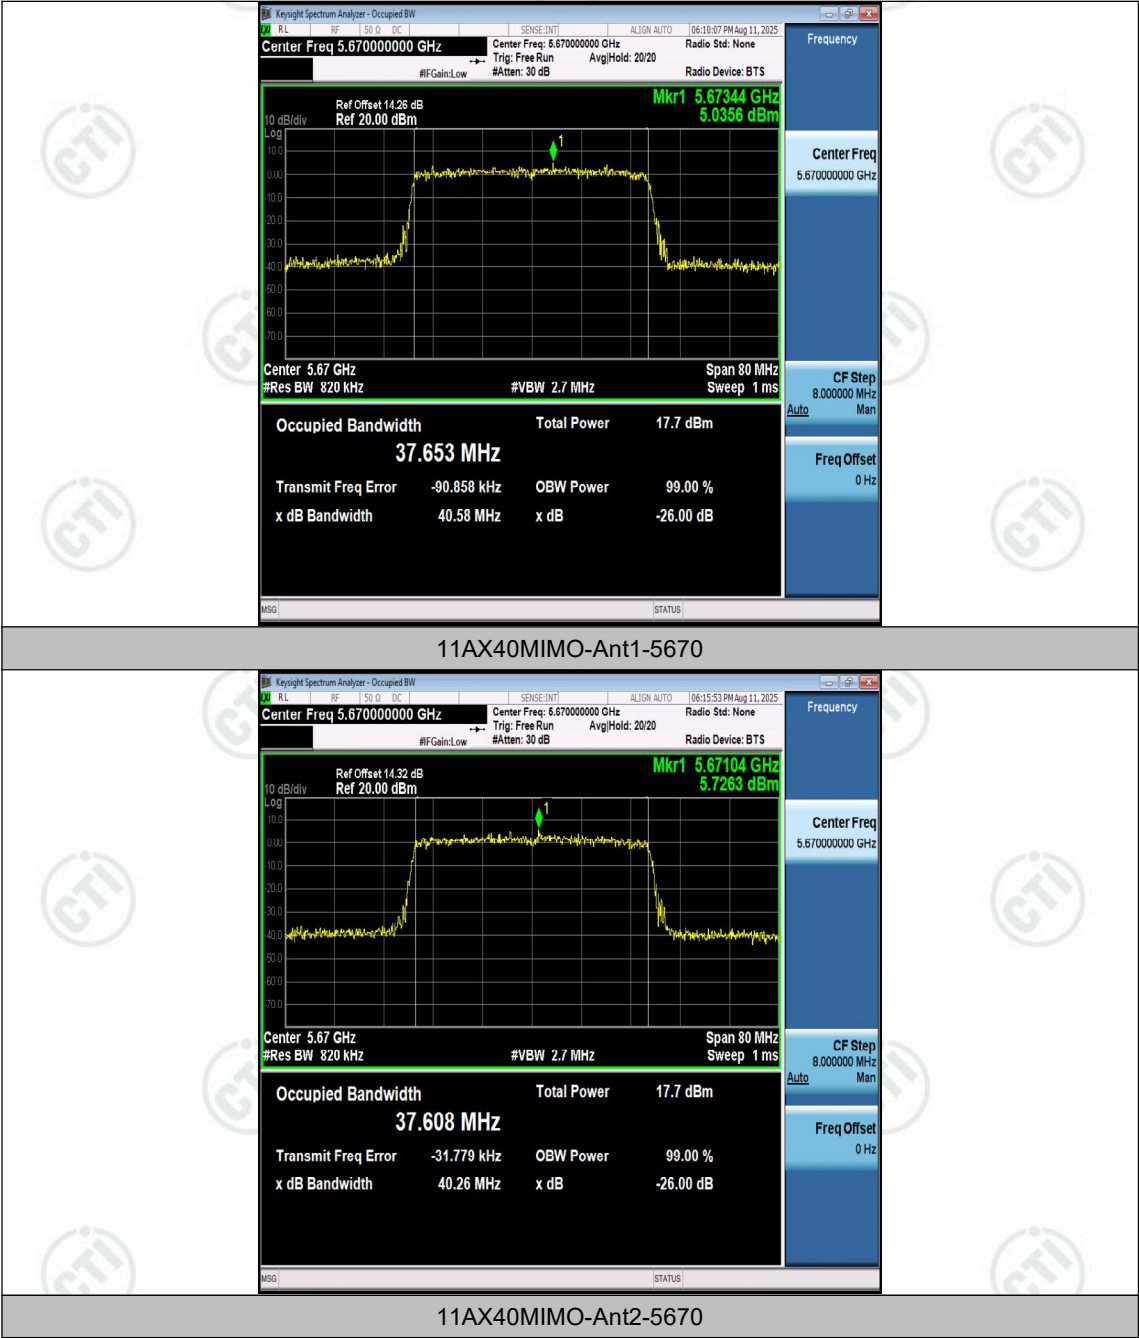


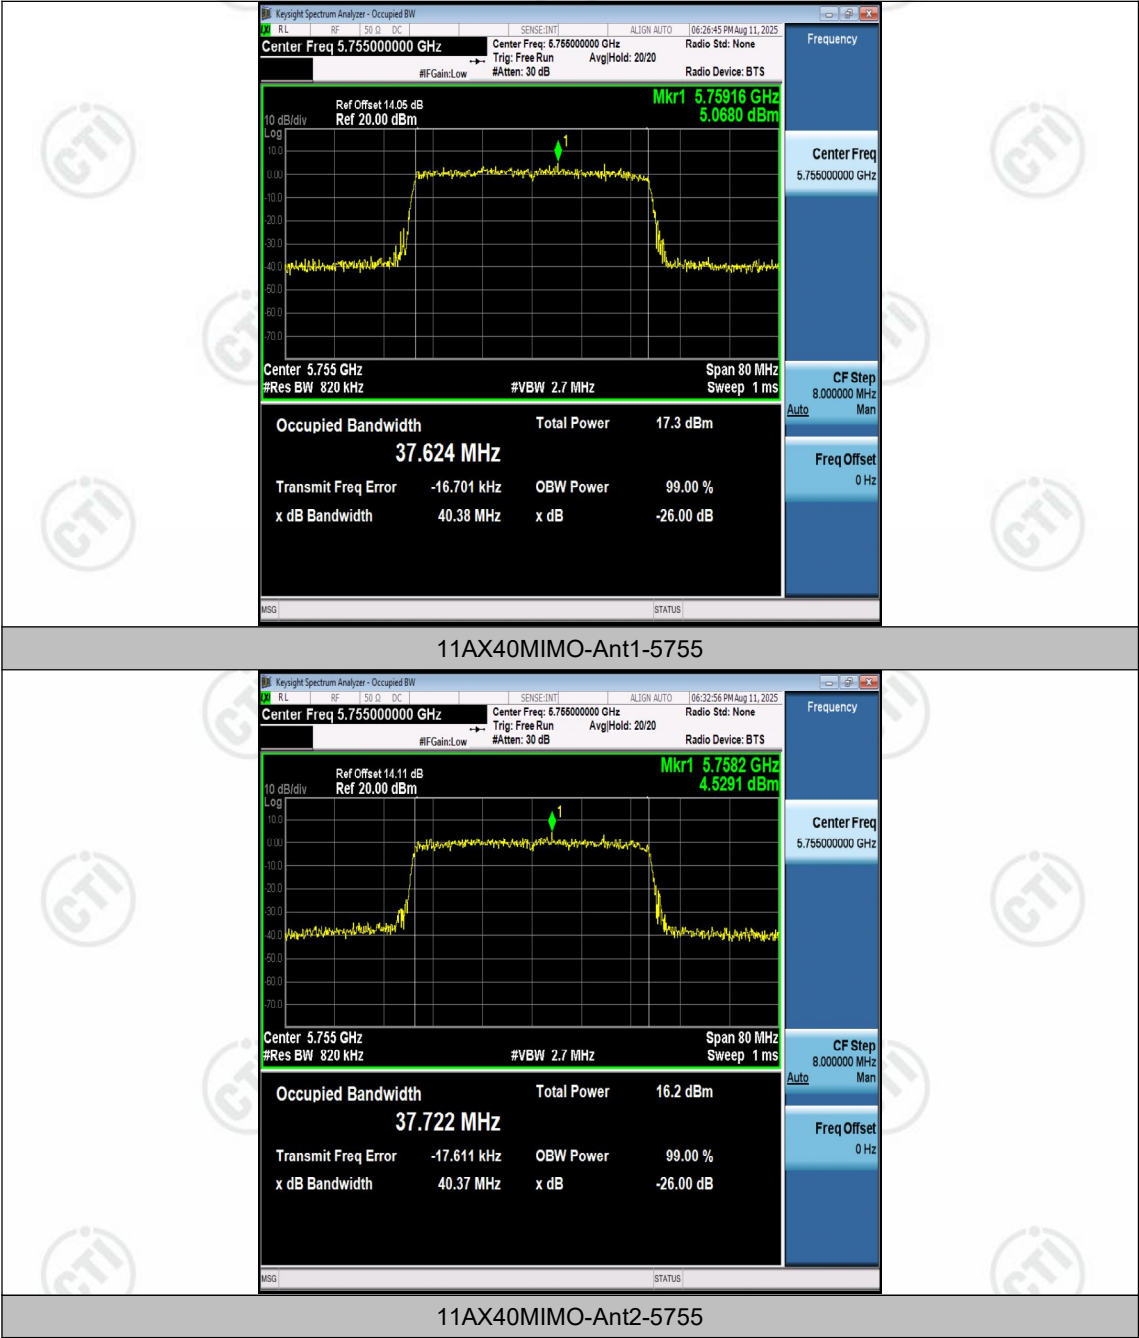


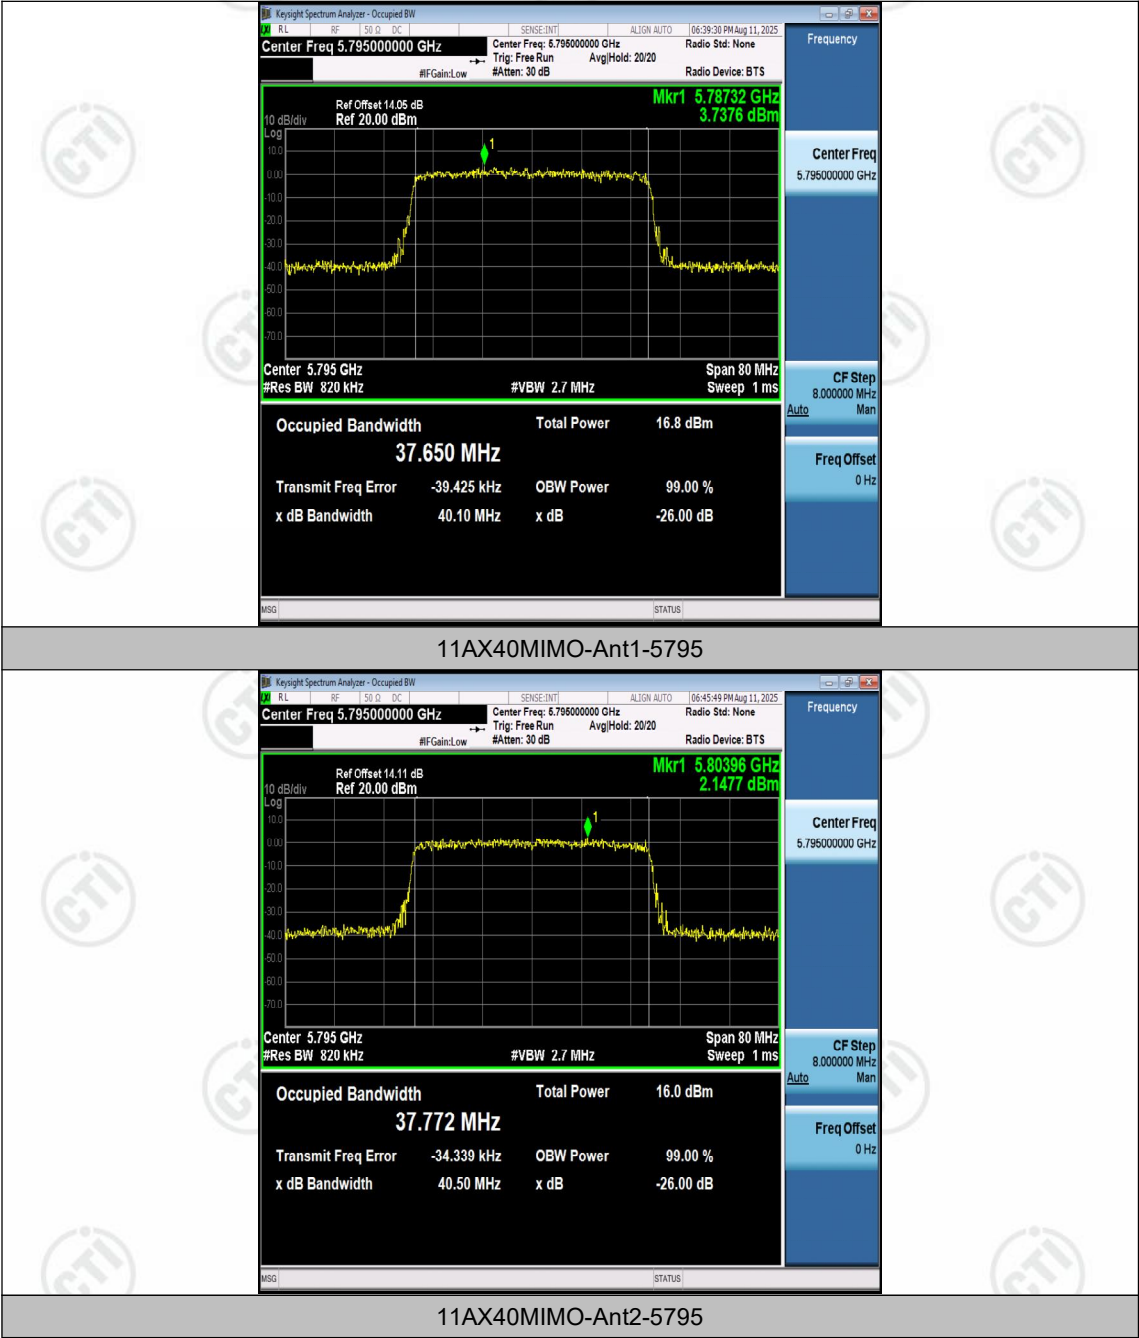


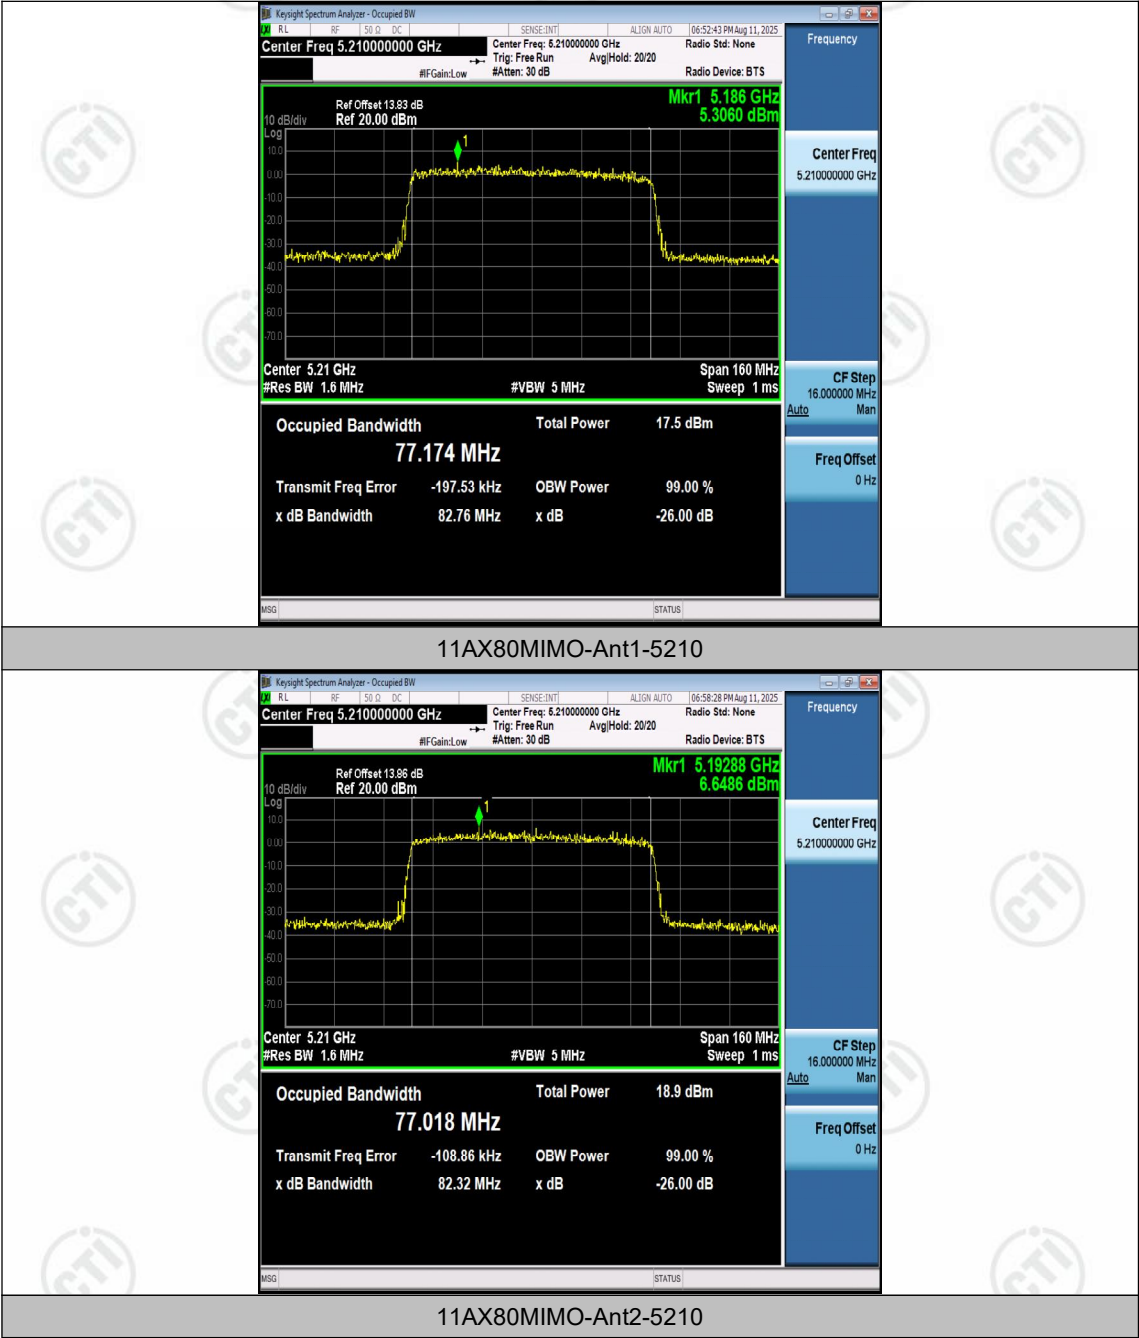


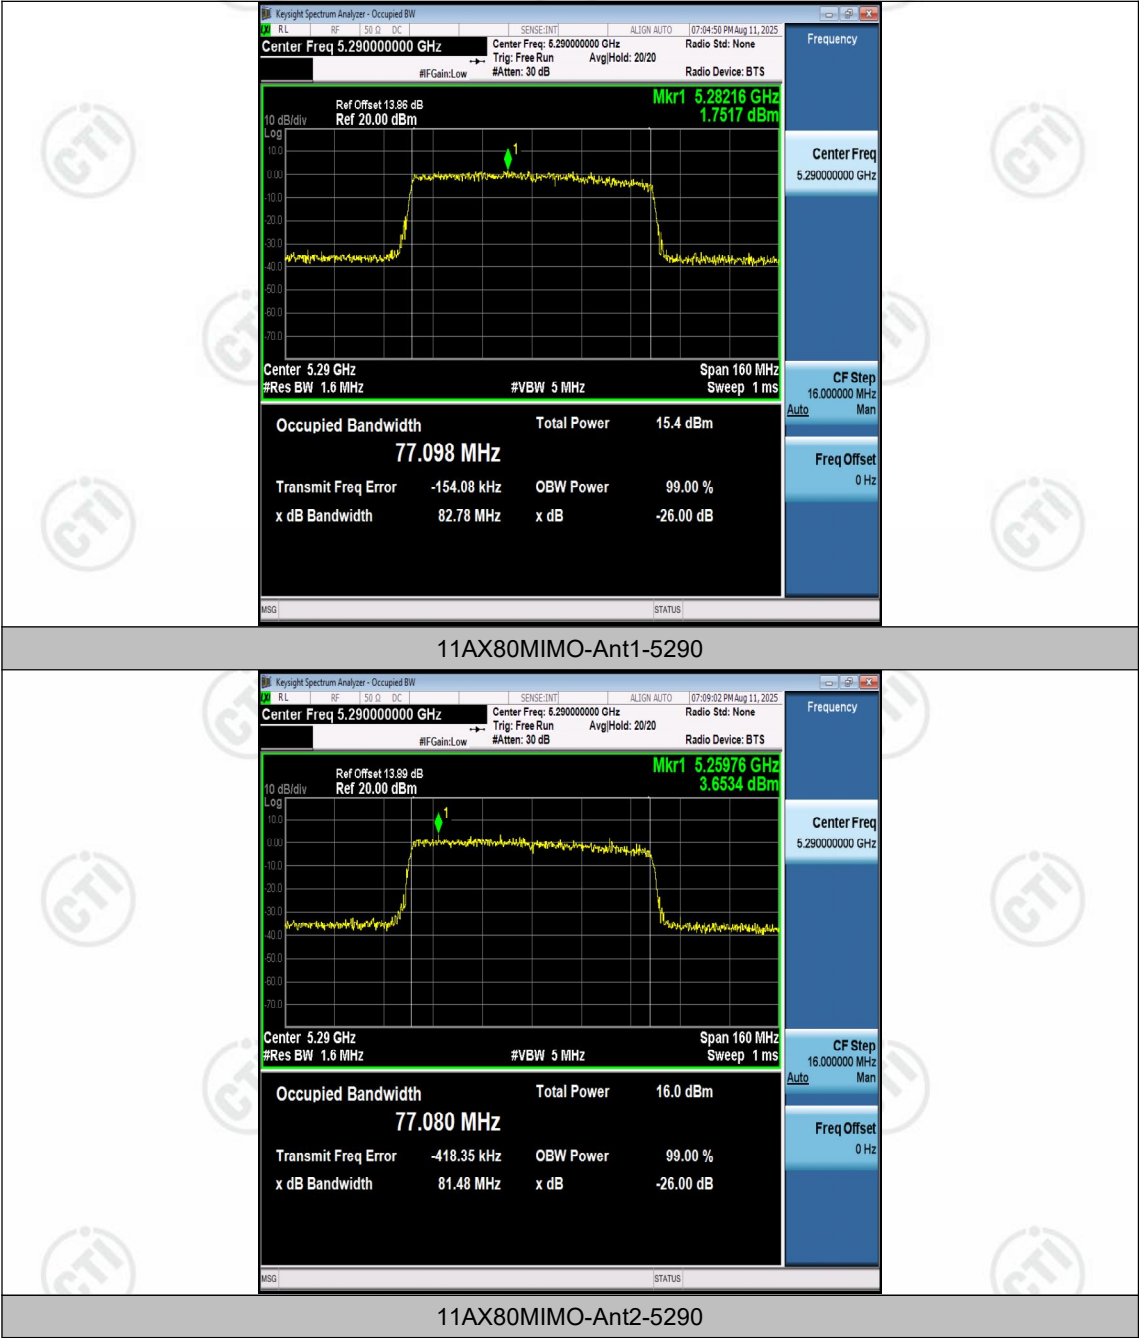


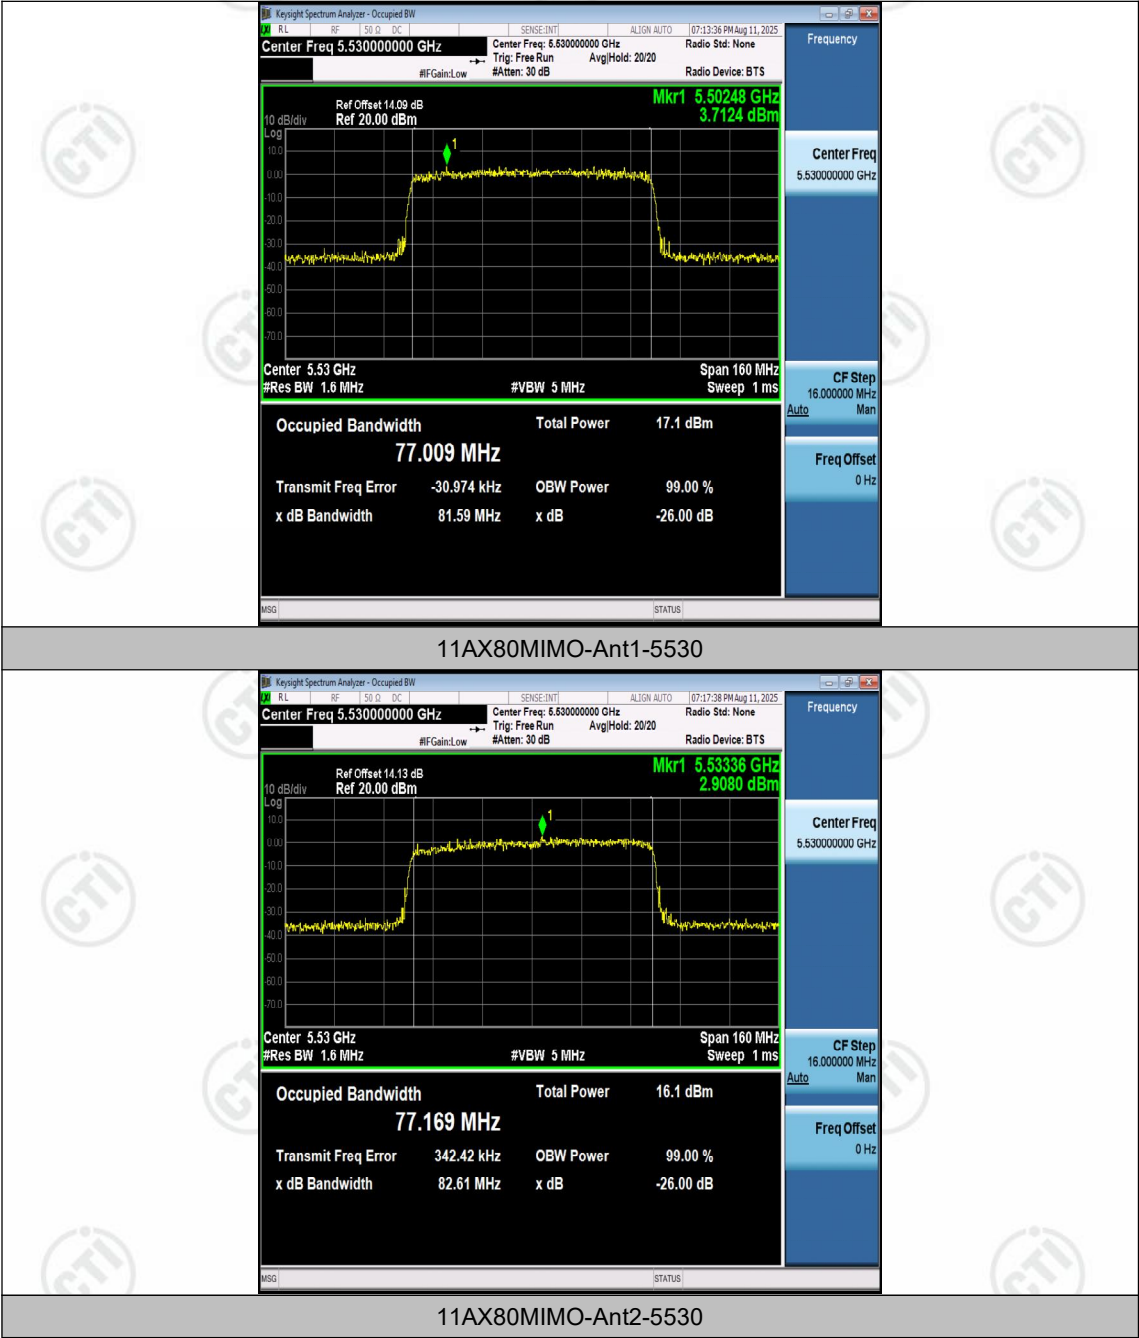

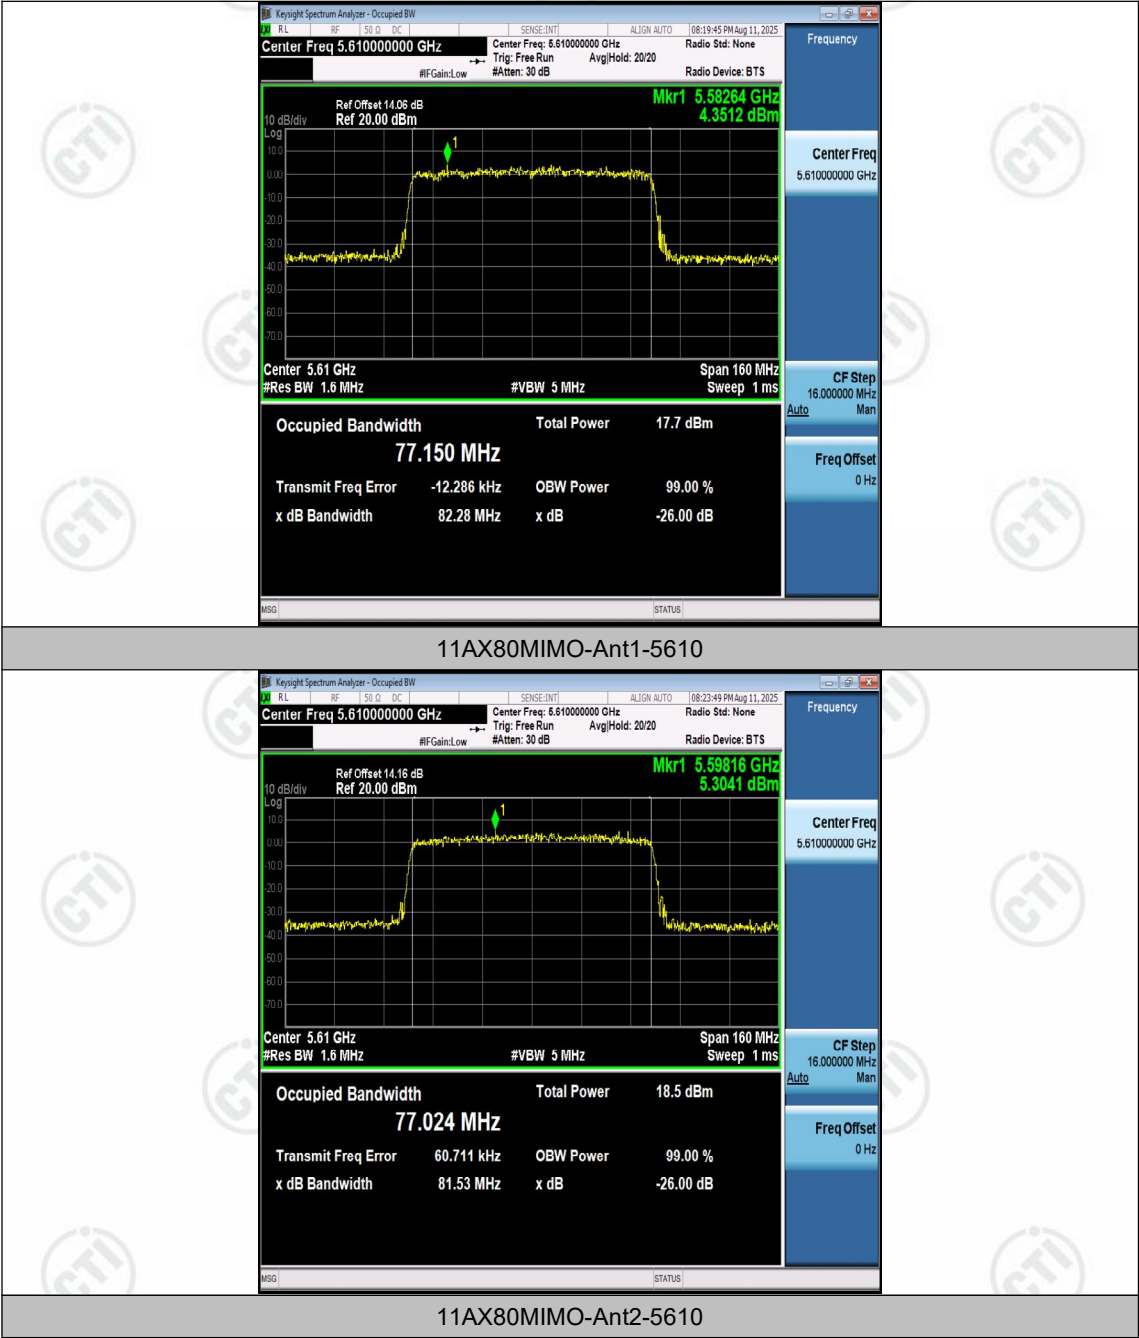

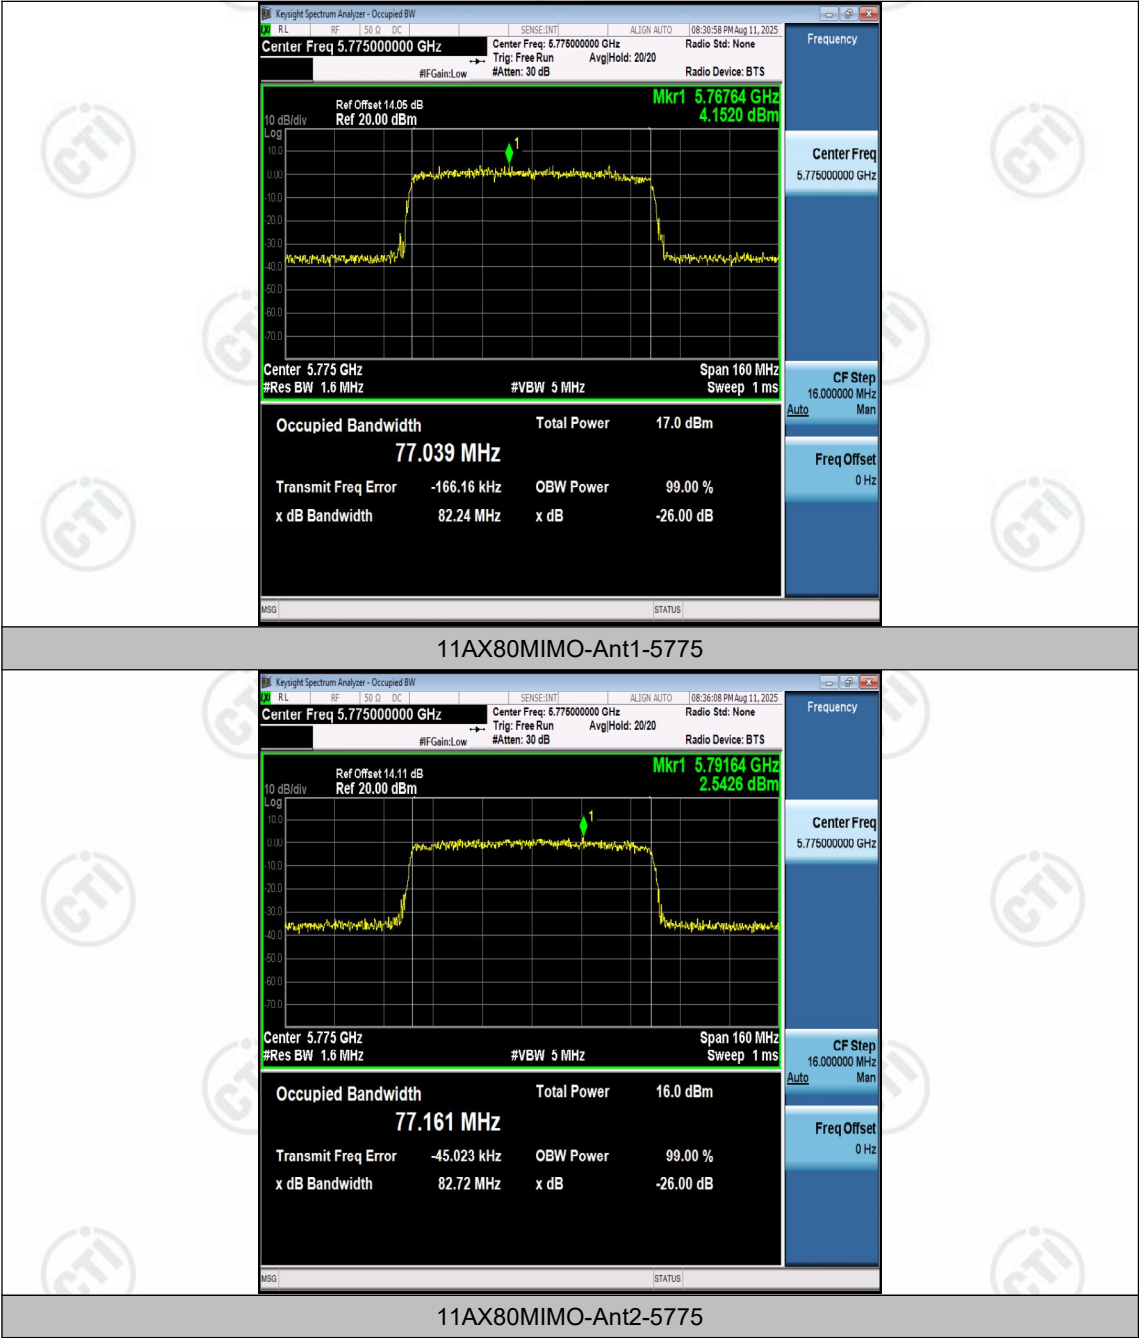

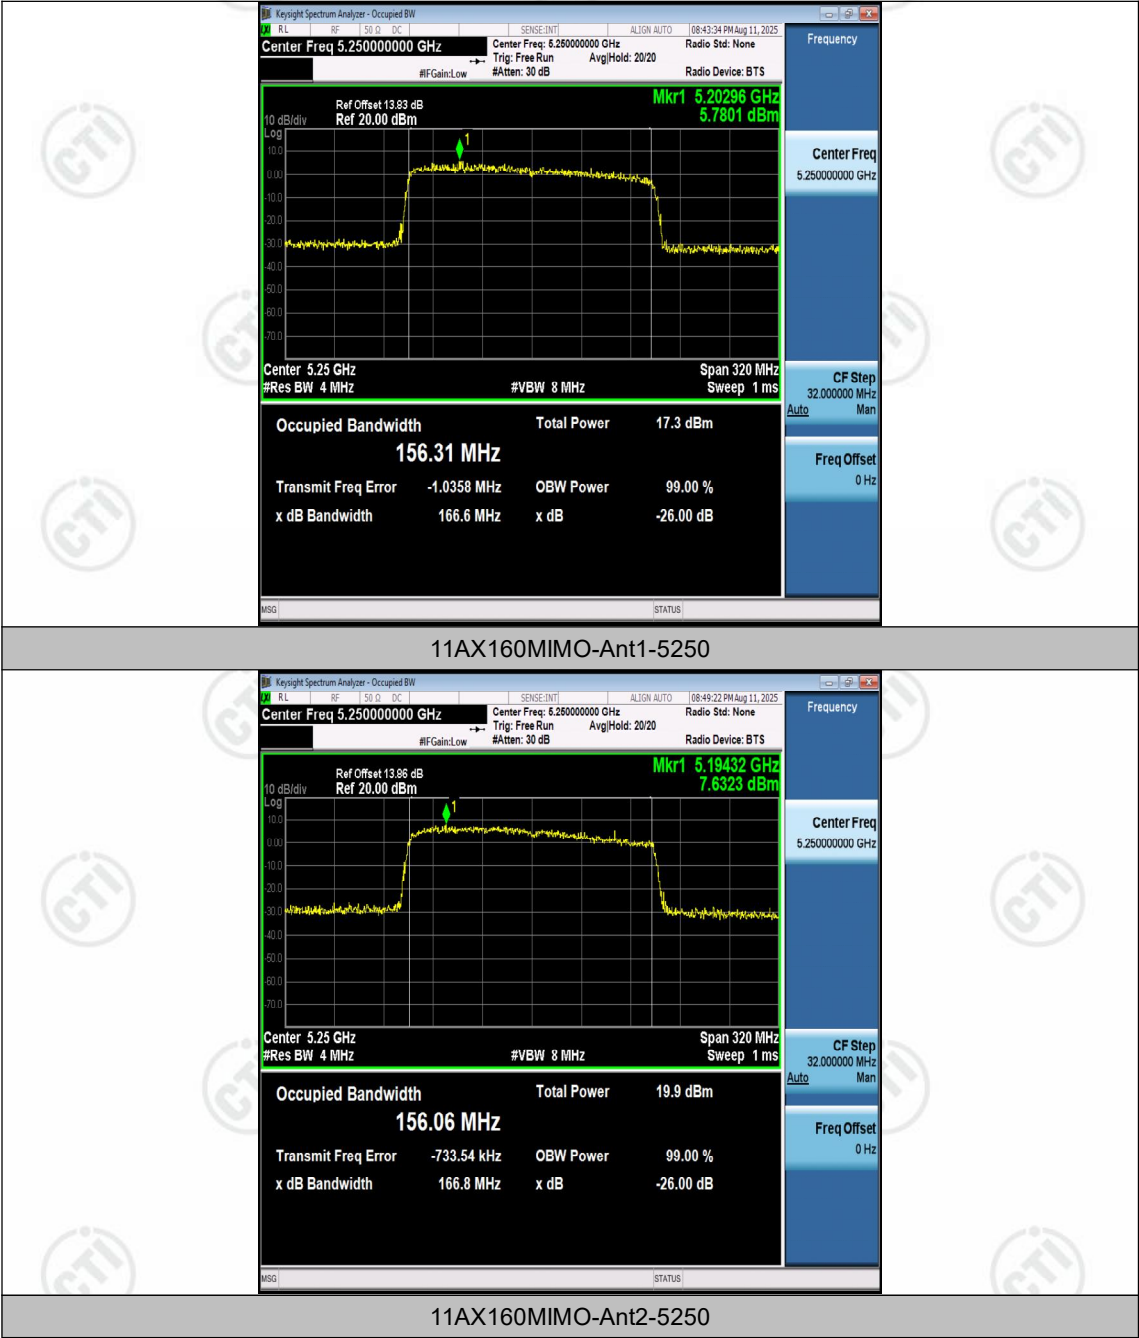

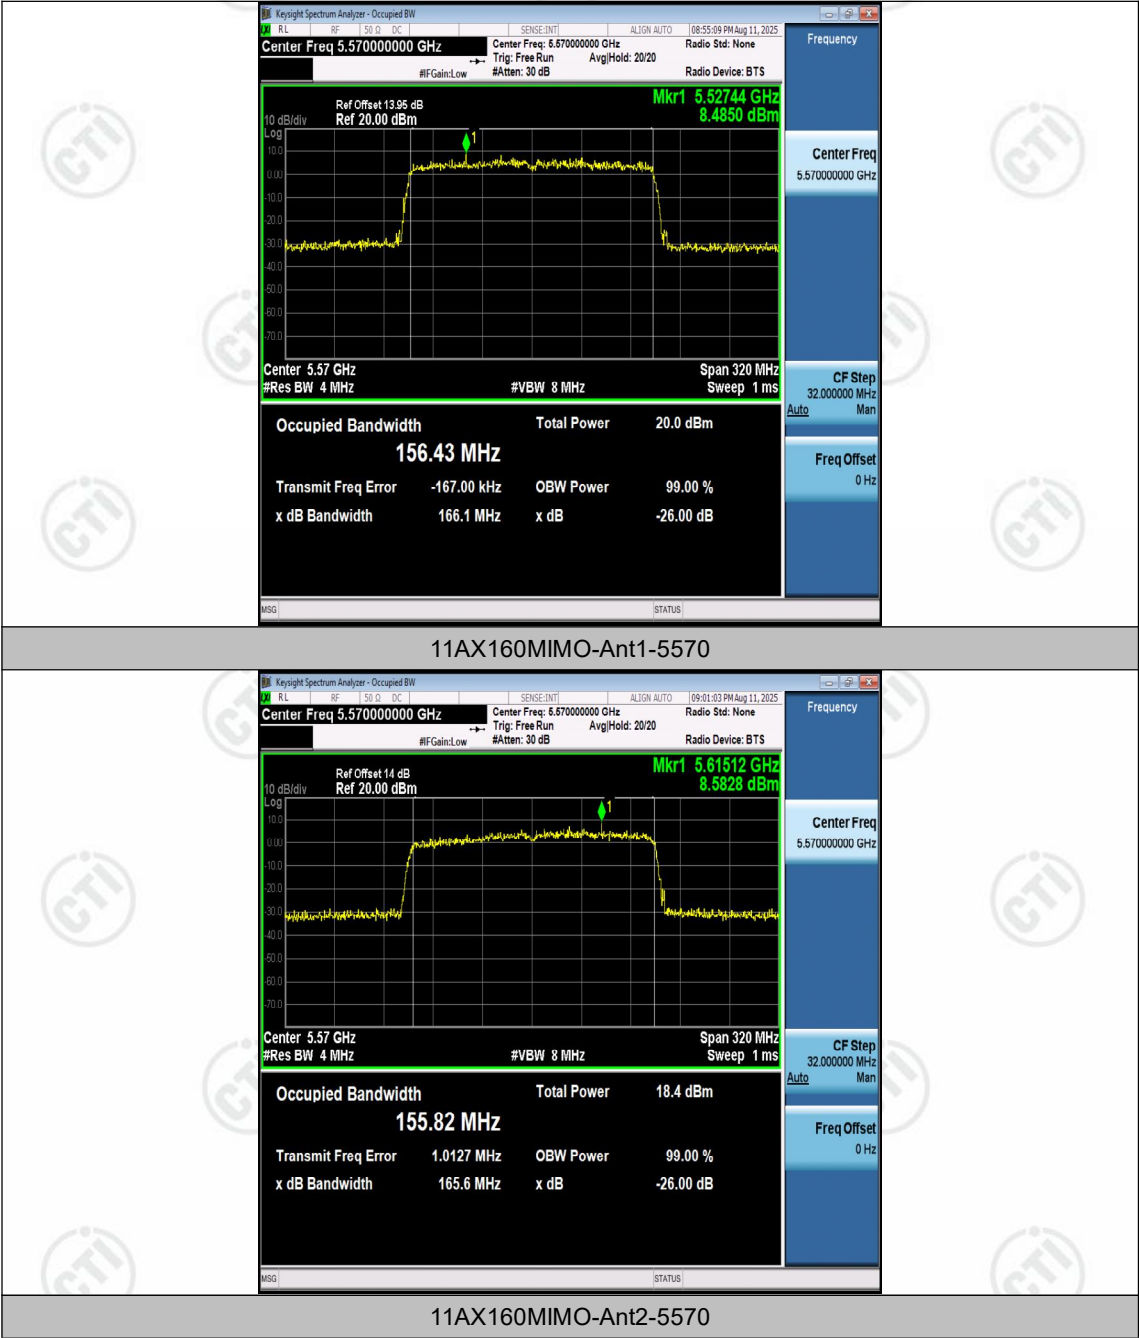

Appendix C: Duty Cycle

Test Result

TestMode	Antenna	Freq(MHz)	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]
11A	Ant1	5180	2.09	2.11	99.05
11A	Ant2	5180	2.10	2.12	99.06
11A	Ant1	5220	2.09	2.11	99.05
11A	Ant2	5220	2.09	2.11	99.05
11A	Ant1	5240	2.10	2.11	99.53
11A	Ant2	5240	2.10	2.11	99.53
11A	Ant1	5260	2.09	2.11	99.05
11A	Ant2	5260	2.09	2.11	99.05
11A	Ant1	5300	2.10	2.12	99.06
11A	Ant2	5300	2.09	2.11	99.05
11A	Ant1	5320	2.10	2.12	99.06
11A	Ant2	5320	2.10	2.12	99.06
11A	Ant1	5500	2.10	2.12	99.06
11A	Ant2	5500	2.09	2.11	99.05
11A	Ant1	5580	2.10	2.11	99.53
11A	Ant2	5580	2.10	2.11	99.53
11A	Ant1	5700	2.09	2.11	99.05
11A	Ant2	5700	2.10	2.11	99.53
11A	Ant1	5745	2.09	2.11	99.05
11A	Ant2	5745	2.09	2.11	99.05
11A	Ant1	5785	2.09	2.11	99.05
11A	Ant2	5785	2.09	2.11	99.05
11A	Ant1	5825	2.09	2.11	99.05
11A	Ant2	5825	2.09	2.11	99.05
11N20MIM O	Ant1	5180	5.43	5.45	99.63
11N20MIM O	Ant2	5180	5.42	5.44	99.63
11N20MIM O	Ant1	5220	5.43	5.45	99.63
11N20MIM O	Ant2	5220	5.43	5.44	99.82
11N20MIM O	Ant1	5240	5.43	5.45	99.63
11N20MIM O	Ant2	5240	5.43	5.45	99.63
11N20MIM	Ant1	5260	5.43	5.44	99.82

O					
11N20MIM O	Ant2	5260	5.43	5.44	99.82
11N20MIM O	Ant1	5300	5.43	5.44	99.82
11N20MIM O	Ant2	5300	5.43	5.45	99.63
11N20MIM O	Ant1	5320	5.43	5.45	99.63
11N20MIM O	Ant2	5320	5.43	5.44	99.82
11N20MIM O	Ant1	5500	5.42	5.44	99.63
11N20MIM O	Ant2	5500	5.43	5.44	99.82
11N20MIM O	Ant1	5580	5.43	5.44	99.82
11N20MIM O	Ant2	5580	5.43	5.45	99.63
11N20MIM O	Ant1	5700	5.43	5.45	99.63
11N20MIM O	Ant2	5700	5.43	5.45	99.63
11N20MIM O	Ant1	5745	5.43	5.45	99.63
11N20MIM O	Ant2	5745	5.43	5.45	99.63
11N20MIM O	Ant1	5785	5.43	5.45	99.63
11N20MIM O	Ant2	5785	5.43	5.45	99.63
11N20MIM O	Ant1	5825	5.43	5.45	99.63
11N20MIM O	Ant2	5825	5.43	5.44	99.82
11N40MIM O	Ant1	5190	5.43	5.45	99.63
11N40MIM O	Ant2	5190	5.42	5.44	99.63
11N40MIM O	Ant1	5230	5.43	5.45	99.63
11N40MIM O	Ant2	5230	5.43	5.45	99.63

11N40MIM O	Ant1	5270	5.43	5.45	99.63
11N40MIM O	Ant2	5270	5.43	5.44	99.82
11N40MIM O	Ant1	5310	5.42	5.44	99.63
11N40MIM O	Ant2	5310	5.43	5.45	99.63
11N40MIM O	Ant1	5510	5.43	5.45	99.63
11N40MIM O	Ant2	5510	5.42	5.44	99.63
11N40MIM O	Ant1	5550	5.43	5.44	99.82
11N40MIM O	Ant2	5550	5.42	5.44	99.63
11N40MIM O	Ant1	5670	5.43	5.44	99.82
11N40MIM O	Ant2	5670	5.43	5.45	99.63
11N40MIM O	Ant1	5755	5.43	5.45	99.63
11N40MIM O	Ant2	5755	5.43	5.45	99.63
11N40MIM O	Ant1	5795	5.43	5.45	99.63
11N40MIM O	Ant2	5795	5.43	5.45	99.63
11AC20MIM O	Ant1	5180	5.43	5.45	99.63
11AC20MIM O	Ant2	5180	5.43	5.45	99.63
11AC20MIM O	Ant1	5220	5.43	5.45	99.63
11AC20MIM O	Ant2	5220	5.43	5.44	99.82
11AC20MIM O	Ant1	5240	5.43	5.44	99.82
11AC20MIM O	Ant2	5240	5.42	5.44	99.63
11AC20MIM O	Ant1	5260	5.42	5.44	99.63
11AC20MIM O	Ant2	5260	5.43	5.44	99.82

O					
11AC20MIM O	Ant1	5300	5.43	5.44	99.82
11AC20MIM O	Ant2	5300	5.42	5.44	99.63
11AC20MIM O	Ant1	5320	5.43	5.44	99.82
11AC20MIM O	Ant2	5320	5.43	5.44	99.82
11AC20MIM O	Ant1	5500	5.43	5.44	99.82
11AC20MIM O	Ant2	5500	5.43	5.45	99.63
11AC20MIM O	Ant1	5580	5.43	5.45	99.63
11AC20MIM O	Ant2	5580	5.42	5.44	99.63
11AC20MIM O	Ant1	5700	5.43	5.45	99.63
11AC20MIM O	Ant2	5700	5.42	5.44	99.63
11AC20MIM O	Ant1	5745	5.43	5.44	99.82
11AC20MIM O	Ant2	5745	5.42	5.44	99.63
11AC20MIM O	Ant1	5785	5.43	5.45	99.63
11AC20MIM O	Ant2	5785	5.43	5.45	99.63
11AC20MIM O	Ant1	5825	5.43	5.45	99.63
11AC20MIM O	Ant2	5825	5.42	5.44	99.63
11AC40MIM O	Ant1	5190	5.43	5.45	99.63
11AC40MIM O	Ant2	5190	5.43	5.44	99.82
11AC40MIM O	Ant1	5230	5.43	5.44	99.82
11AC40MIM O	Ant2	5230	5.42	5.44	99.63
11AC40MIM O	Ant1	5270	5.43	5.45	99.63

11AC40MIM O	Ant2	5270	5.43	5.45	99.63
11AC40MIM O	Ant1	5310	5.43	5.45	99.63
11AC40MIM O	Ant2	5310	5.43	5.45	99.63
11AC40MIM O	Ant1	5510	5.43	5.44	99.82
11AC40MIM O	Ant2	5510	5.43	5.44	99.82
11AC40MIM O	Ant1	5550	5.43	5.45	99.63
11AC40MIM O	Ant2	5550	5.43	5.44	99.82
11AC40MIM O	Ant1	5670	5.43	5.44	99.82
11AC40MIM O	Ant2	5670	5.42	5.44	99.63
11AC40MIM O	Ant1	5755	5.43	5.44	99.82
11AC40MIM O	Ant2	5755	5.43	5.44	99.82
11AC40MIM O	Ant1	5795	5.43	5.44	99.82
11AC40MIM O	Ant2	5795	5.43	5.45	99.63
11AC80MIM O	Ant1	5210	5.43	5.44	99.82
11AC80MIM O	Ant2	5210	5.43	5.44	99.82
11AC80MIM O	Ant1	5290	5.43	5.44	99.82
11AC80MIM O	Ant2	5290	5.42	5.44	99.63
11AC80MIM O	Ant1	5530	5.43	5.44	99.82
11AC80MIM O	Ant2	5530	5.43	5.44	99.82
11AC80MIM O	Ant1	5610	5.43	5.44	99.82
11AC80MIM O	Ant2	5610	5.43	5.45	99.63
11AC80MIM	Ant1	5775	5.42	5.44	99.63

O					
11AC80MIM O	Ant2	5775	5.42	5.44	99.63
11AC160MI MO	Ant1	5250	5.43	5.45	99.63
11AC160MI MO	Ant2	5250	5.42	5.44	99.63
11AC160MI MO	Ant1	5570	5.43	5.44	99.82
11AC160MI MO	Ant2	5570	5.43	5.45	99.63
11AX20MIM O	Ant1	5180	5.44	5.46	99.63
11AX20MIM O	Ant2	5180	5.45	5.46	99.82
11AX20MIM O	Ant1	5220	5.44	5.46	99.63
11AX20MIM O	Ant2	5220	5.45	5.46	99.82
11AX20MIM O	Ant1	5240	5.44	5.46	99.63
11AX20MIM O	Ant2	5240	5.45	5.47	99.63
11AX20MIM O	Ant1	5260	5.44	5.46	99.63
11AX20MIM O	Ant2	5260	5.44	5.46	99.63
11AX20MIM O	Ant1	5300	5.44	5.46	99.63
11AX20MIM O	Ant2	5300	5.45	5.46	99.82
11AX20MIM O	Ant1	5320	5.44	5.46	99.63
11AX20MIM O	Ant2	5320	5.44	5.46	99.63
11AX20MIM O	Ant1	5500	5.45	5.46	99.82
11AX20MIM O	Ant2	5500	5.45	5.46	99.82
11AX20MIM O	Ant1	5580	5.44	5.46	99.63
11AX20MIM O	Ant2	5580	5.44	5.46	99.63

11AX20MIM O	Ant1	5700	5.44	5.46	99.63
11AX20MIM O	Ant2	5700	5.44	5.46	99.63
11AX20MIM O	Ant1	5745	5.44	5.46	99.63
11AX20MIM O	Ant2	5745	5.44	5.46	99.63
11AX20MIM O	Ant1	5785	5.45	5.46	99.82
11AX20MIM O	Ant2	5785	5.45	5.46	99.82
11AX20MIM O	Ant1	5825	5.45	5.46	99.82
11AX20MIM O	Ant2	5825	5.45	5.46	99.82
11AX40MIM O	Ant1	5190	5.44	5.46	99.63
11AX40MIM O	Ant2	5190	5.44	5.46	99.63
11AX40MIM O	Ant1	5230	5.45	5.46	99.82
11AX40MIM O	Ant2	5230	5.44	5.46	99.63
11AX40MIM O	Ant1	5270	5.44	5.46	99.63
11AX40MIM O	Ant2	5270	5.44	5.46	99.63
11AX40MIM O	Ant1	5310	5.45	5.46	99.82
11AX40MIM O	Ant2	5310	5.45	5.46	99.82
11AX40MIM O	Ant1	5510	5.45	5.46	99.82
11AX40MIM O	Ant2	5510	5.45	5.46	99.82
11AX40MIM O	Ant1	5550	5.45	5.46	99.82
11AX40MIM O	Ant2	5550	5.45	5.47	99.63
11AX40MIM O	Ant1	5670	5.44	5.46	99.63
11AX40MIM	Ant2	5670	5.45	5.47	99.63

O					
11AX40MIM O	Ant1	5755	5.44	5.46	99.63
11AX40MIM O	Ant2	5755	5.45	5.46	99.82
11AX40MIM O	Ant1	5795	5.44	5.46	99.63
11AX40MIM O	Ant2	5795	5.45	5.46	99.82
11AX80MIM O	Ant1	5210	5.44	5.46	99.63
11AX80MIM O	Ant2	5210	5.44	5.46	99.63
11AX80MIM O	Ant1	5290	5.44	5.46	99.63
11AX80MIM O	Ant2	5290	5.44	5.46	99.63
11AX80MIM O	Ant1	5530	5.44	5.46	99.63
11AX80MIM O	Ant2	5530	5.44	5.46	99.63
11AX80MIM O	Ant1	5610	5.44	5.46	99.63
11AX80MIM O	Ant2	5610	5.44	5.46	99.63
11AX80MIM O	Ant1	5775	5.44	5.46	99.63
11AX80MIM O	Ant2	5775	5.44	5.46	99.63
11AX160MI MO	Ant1	5250	5.44	5.46	99.63
11AX160MI MO	Ant2	5250	5.45	5.46	99.82
11AX160MI MO	Ant1	5570	5.44	5.46	99.63
11AX160MI MO	Ant2	5570	5.44	5.46	99.63

Test Graphs

