



Test Graphs

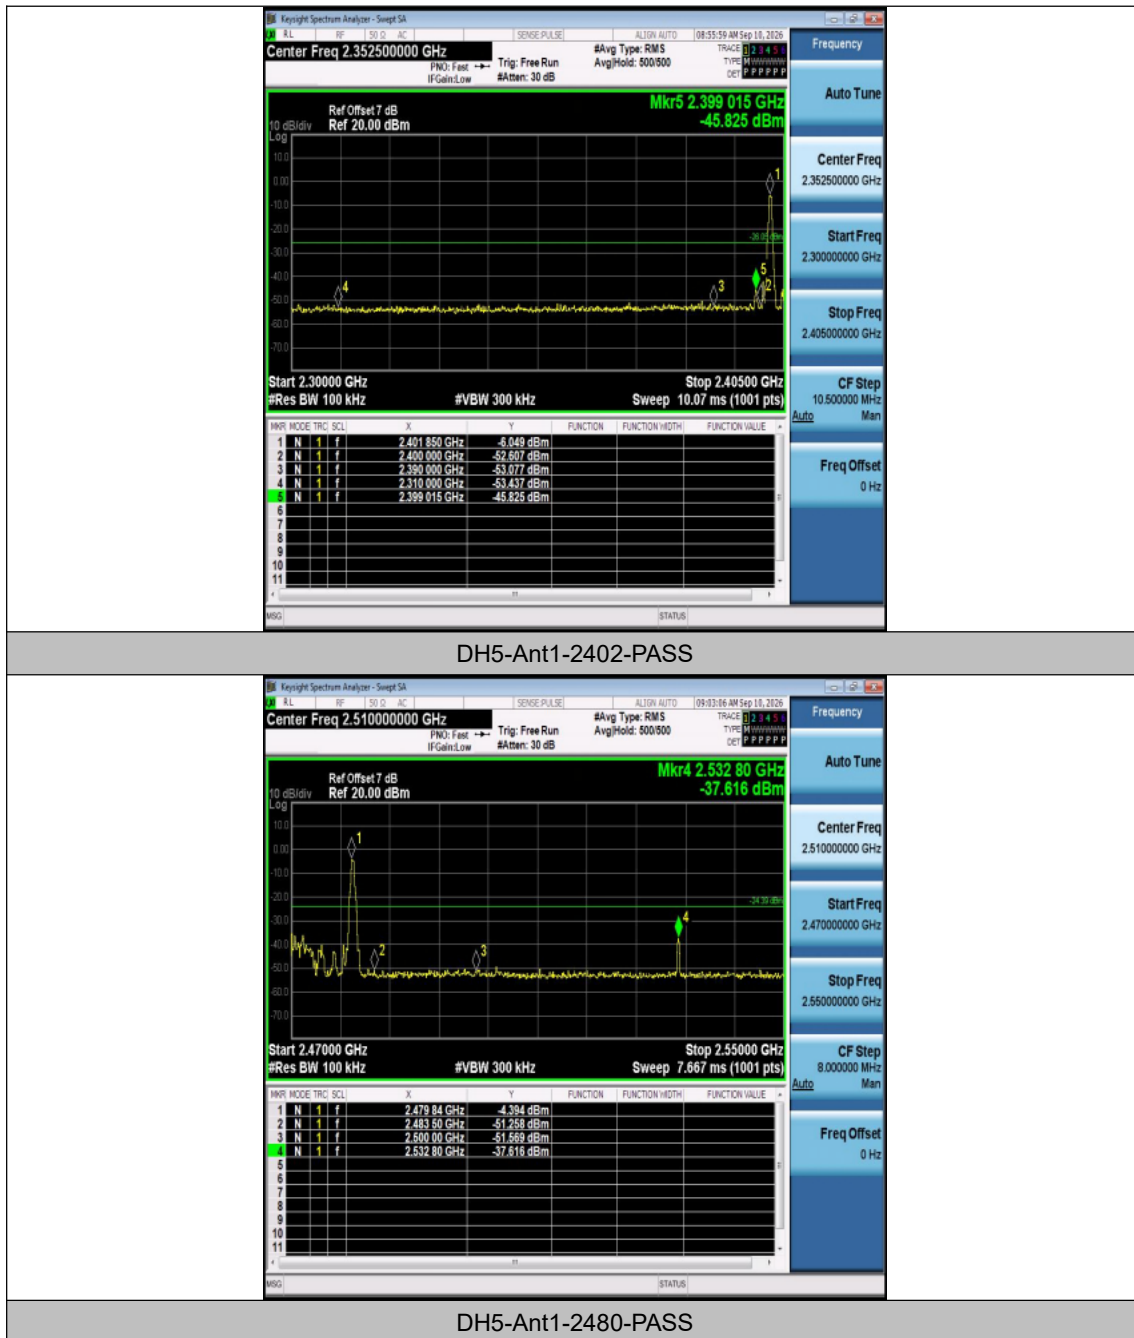



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

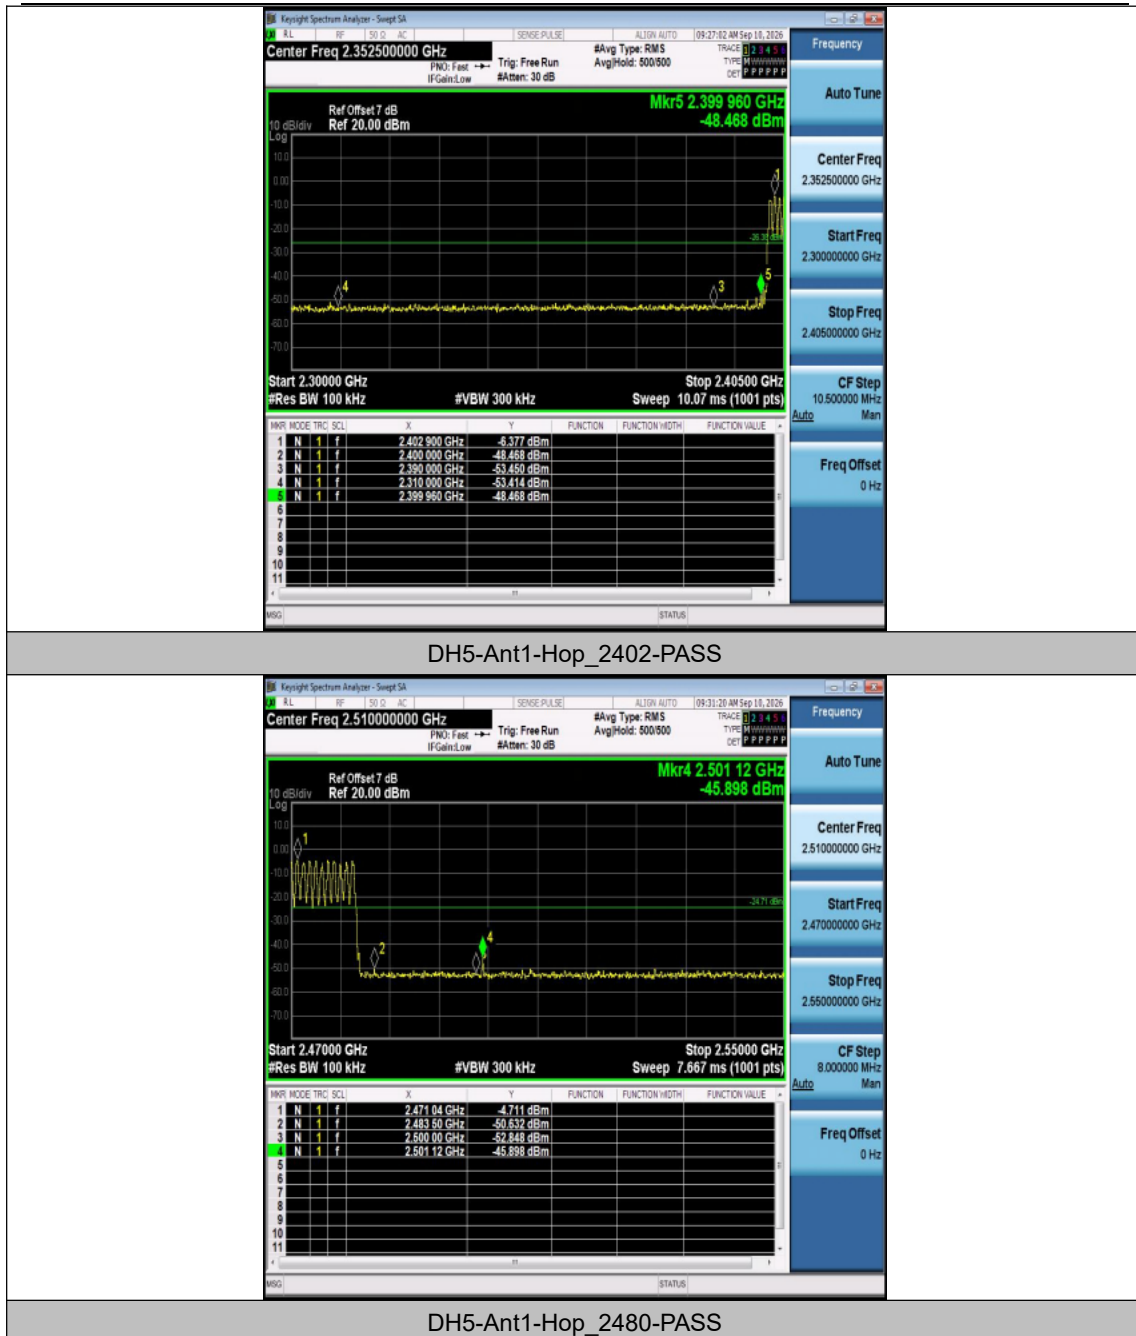

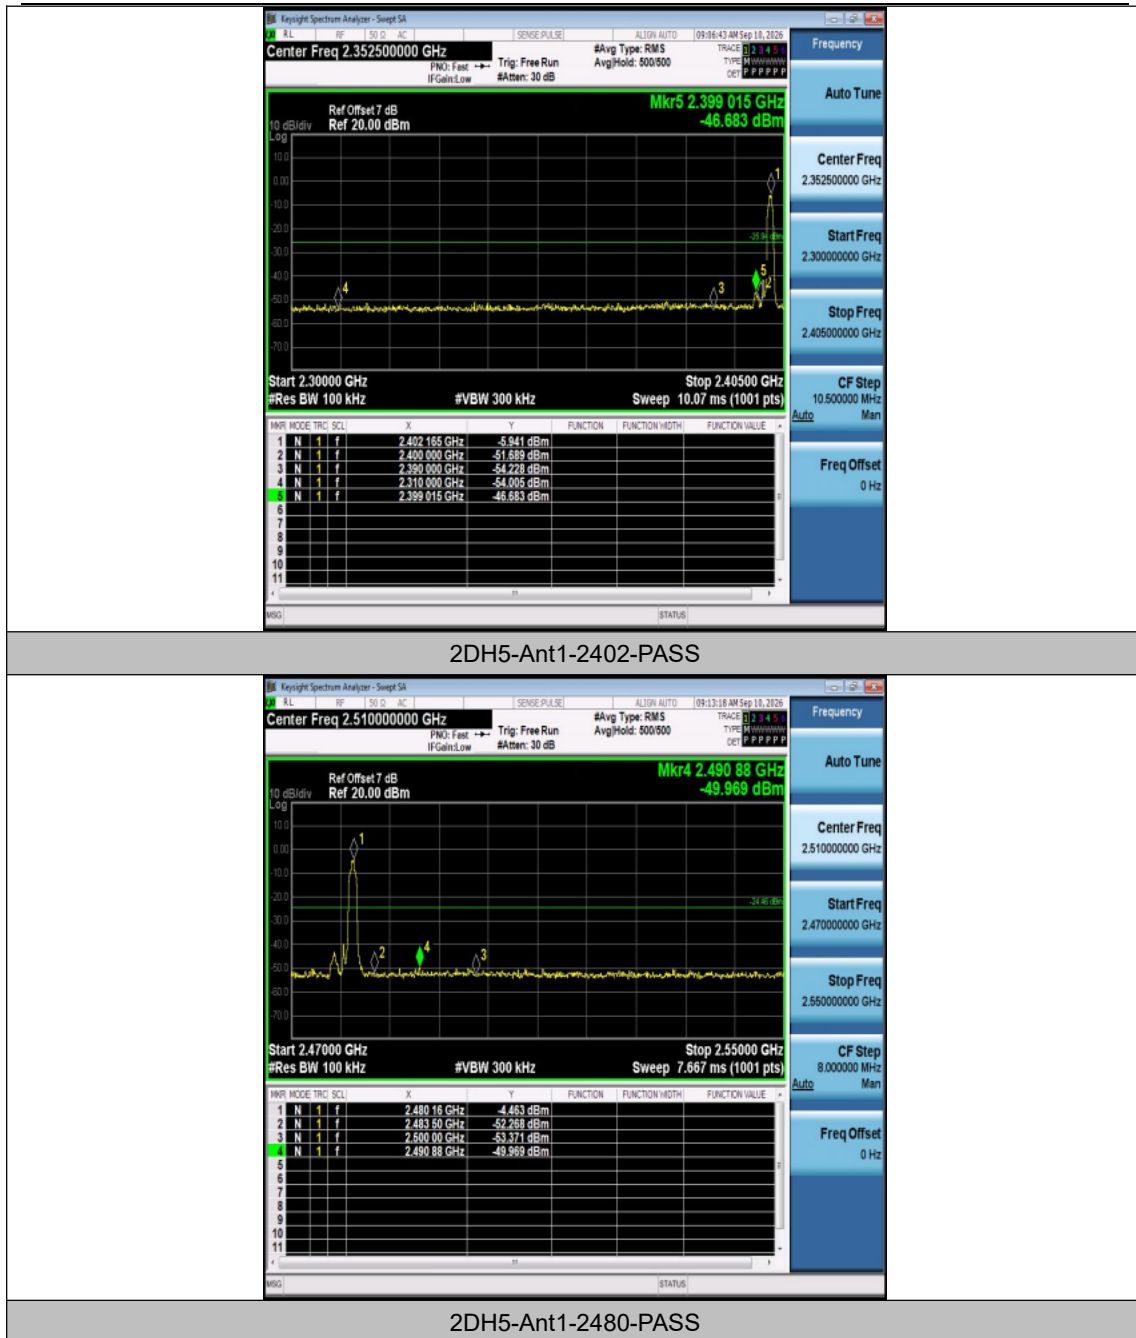

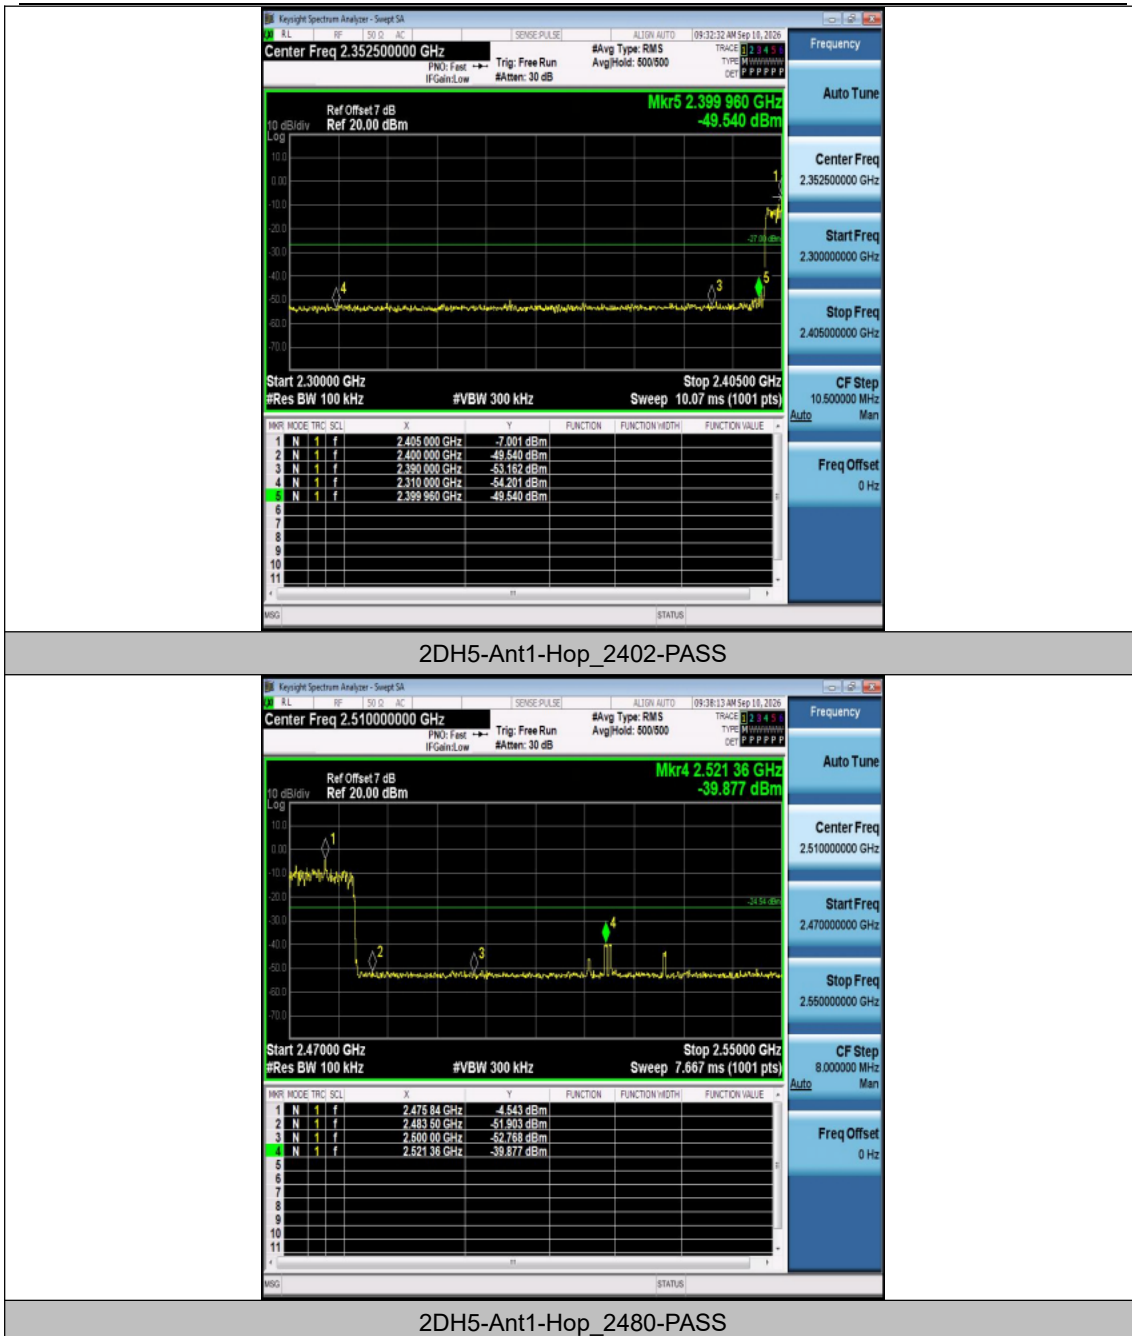

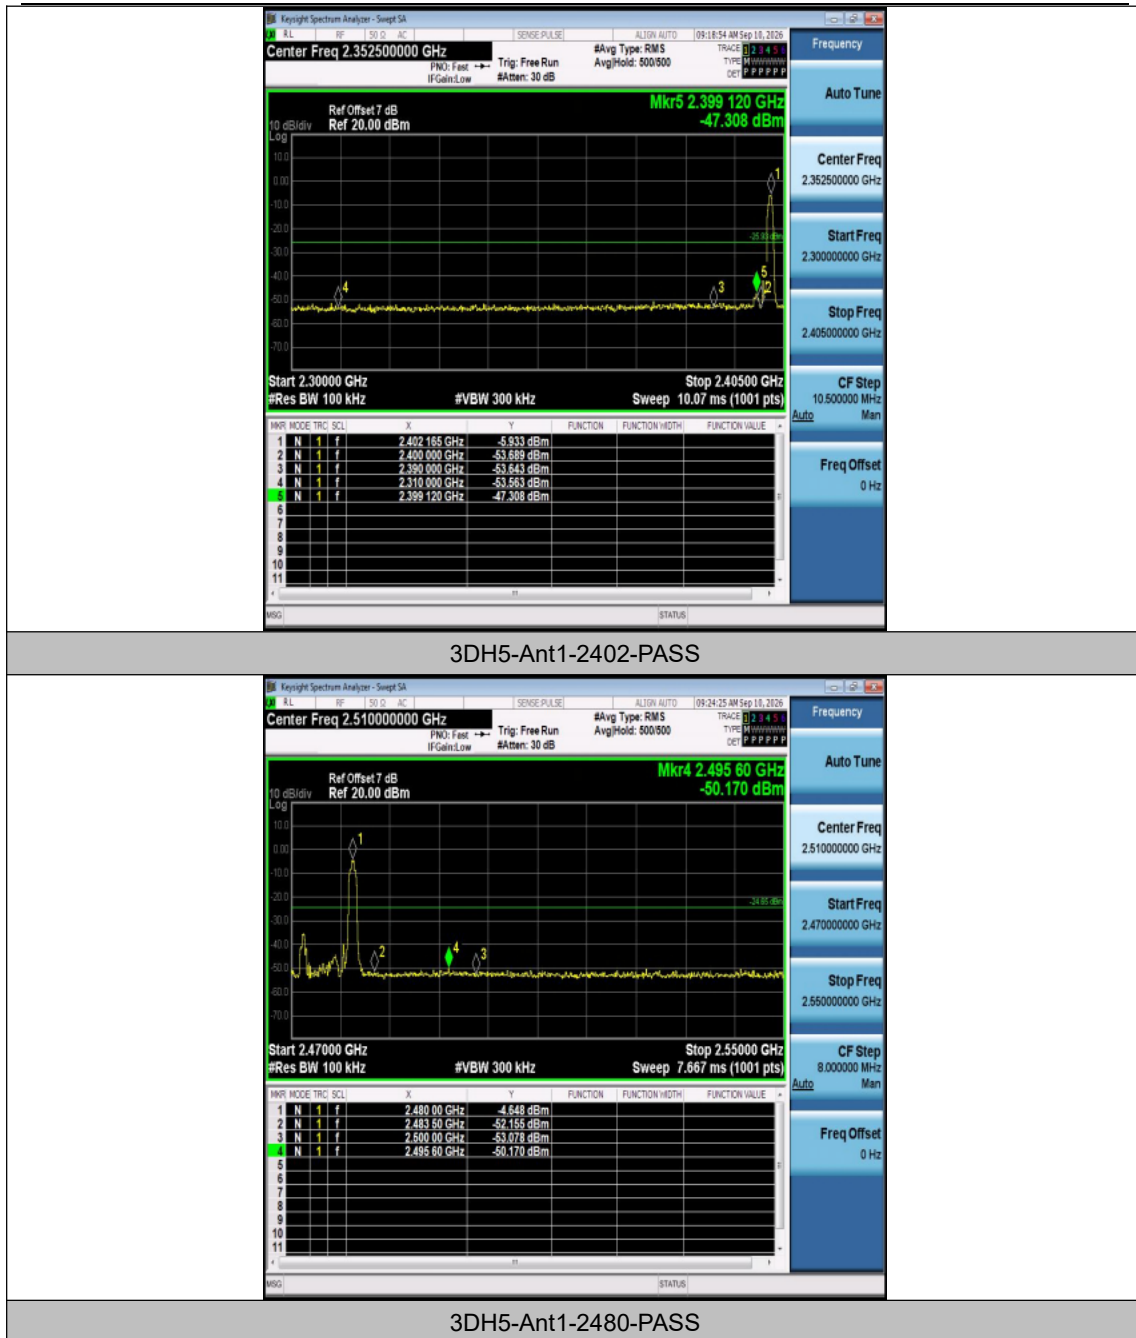

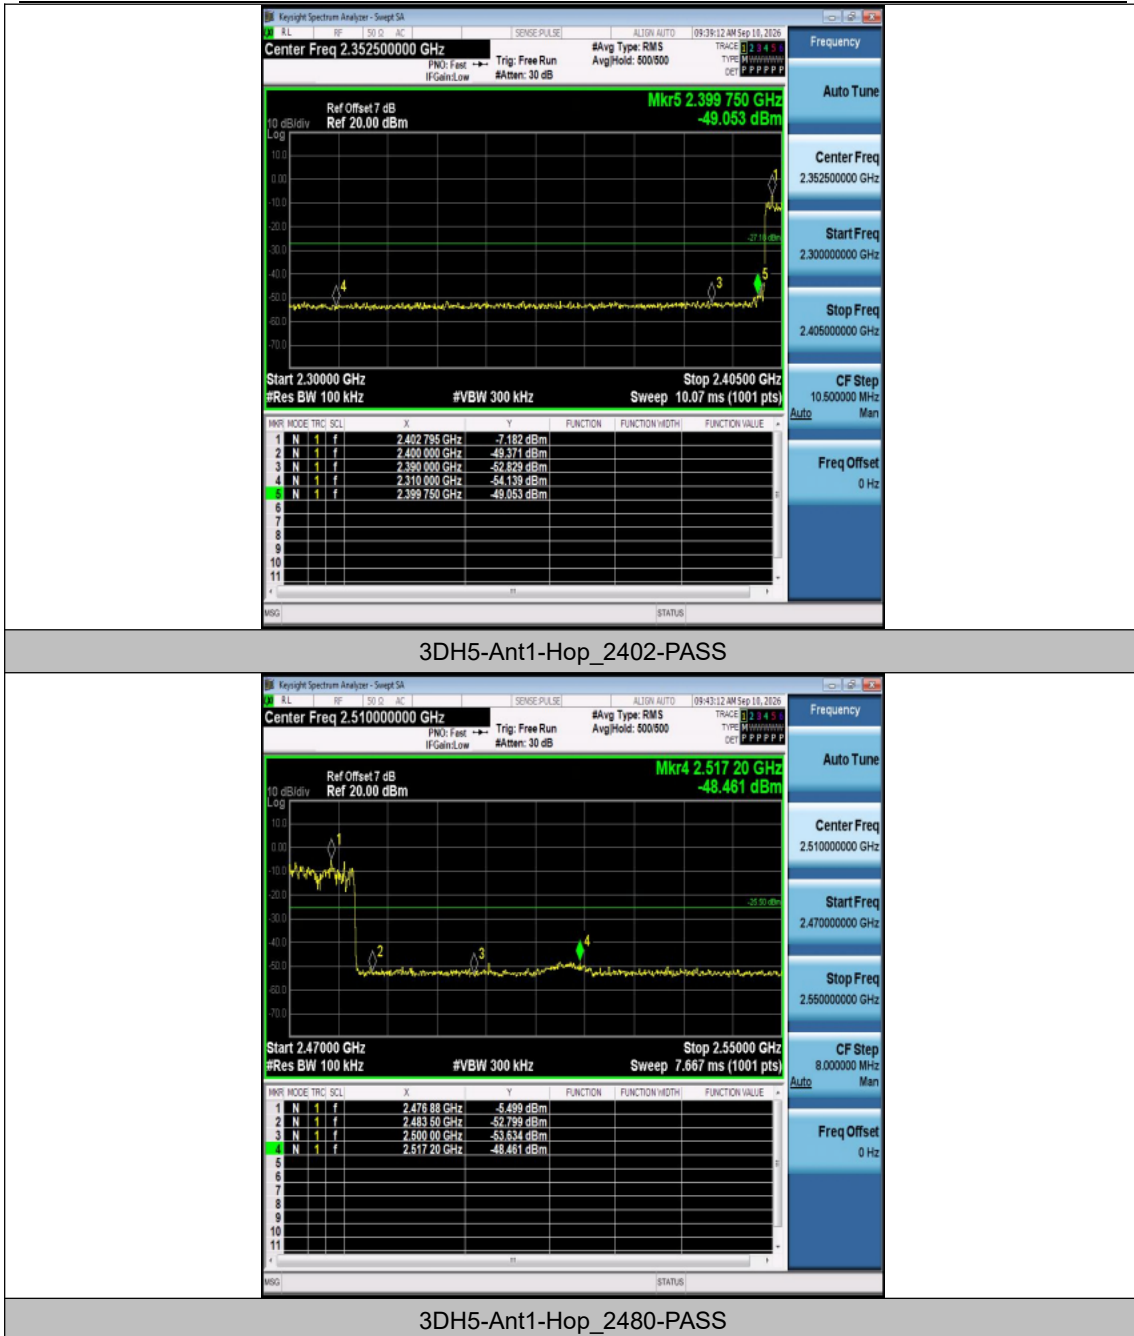


Appendix H: Conducted Spurious Emission

Test Result

Test Mode	Antenna	Frequency[MHz]	Freq. Range [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	2402	0~Reference	-6.64	-6.64	---	PASS
DH5	Ant1	2402	30~1000	-6.64	-46.82	≤-26.64	PASS
DH5	Ant1	2402	1000~26500	-6.64	-37.81	≤-26.64	PASS
DH5	Ant1	2441	0~Reference	-5.18	-5.18	---	PASS
DH5	Ant1	2441	30~1000	-5.18	-52.7	≤-25.18	PASS
DH5	Ant1	2441	1000~26500	-5.18	-37.3	≤-25.18	PASS
DH5	Ant1	2480	0~Reference	-4.76	-4.76	---	PASS
DH5	Ant1	2480	30~1000	-4.76	-51.96	≤-24.76	PASS
DH5	Ant1	2480	1000~26500	-4.76	-37.34	≤-24.76	PASS
2DH5	Ant1	2402	0~Reference	-6.98	-6.98	---	PASS
2DH5	Ant1	2402	30~1000	-6.98	-52.57	≤-26.98	PASS
2DH5	Ant1	2402	1000~26500	-6.98	-37.53	≤-26.98	PASS
2DH5	Ant1	2441	0~Reference	-4.98	-4.98	---	PASS
2DH5	Ant1	2441	30~1000	-4.98	-52.1	≤-24.98	PASS
2DH5	Ant1	2441	1000~26500	-4.98	-35.14	≤-24.98	PASS
2DH5	Ant1	2480	0~Reference	-4.53	-4.53	---	PASS
2DH5	Ant1	2480	30~1000	-4.53	-50.2	≤-24.53	PASS
2DH5	Ant1	2480	1000~26500	-4.53	-37.37	≤-24.53	PASS
3DH5	Ant1	2402	0~Reference	-6.14	-6.14	---	PASS
3DH5	Ant1	2402	30~1000	-6.14	-35.68	≤-26.14	PASS
3DH5	Ant1	2402	1000~26500	-6.14	-36.21	≤-26.14	PASS
3DH5	Ant1	2441	0~Reference	-4.90	-4.90	---	PASS
3DH5	Ant1	2441	30~1000	-4.90	-51.13	≤-24.9	PASS
3DH5	Ant1	2441	1000~26500	-4.90	-37.45	≤-24.9	PASS
3DH5	Ant1	2480	0~Reference	-4.61	-4.61	---	PASS
3DH5	Ant1	2480	30~1000	-4.61	-33.39	≤-24.61	PASS
3DH5	Ant1	2480	1000~26500	-4.61	-36.1	≤-24.61	PASS

Remark:Regarding the spurious emissions from 30MHz to 26.5GHz, the cable loss have been set in the 'Input Correction' of the Spectrum Analyzer during the test.

Test Graphs

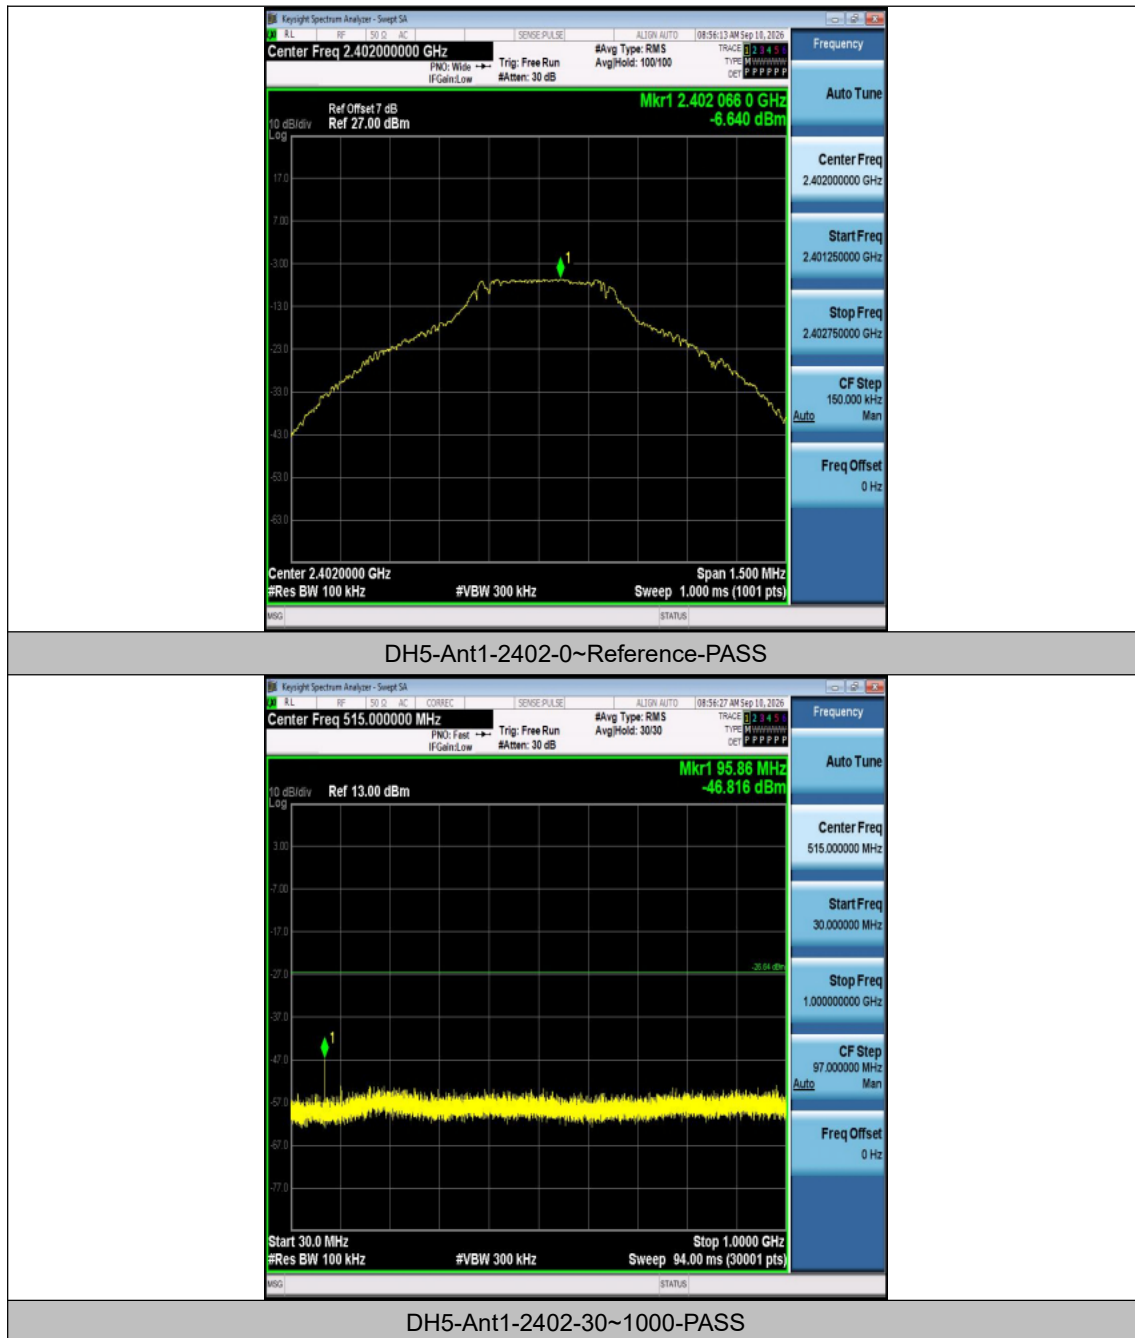

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

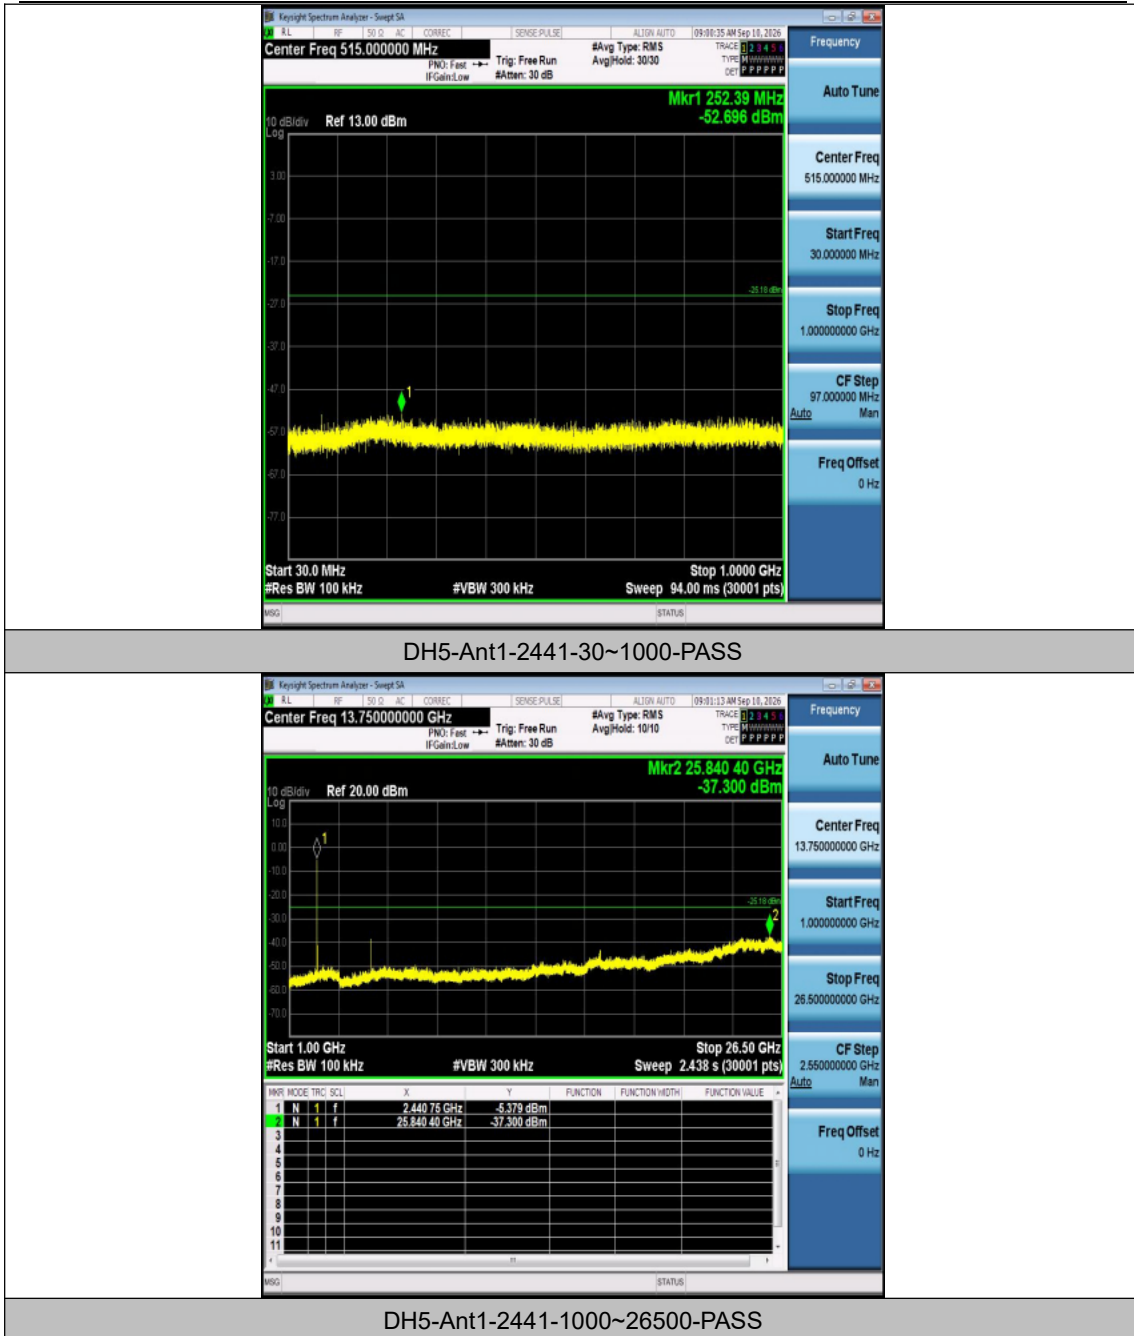

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

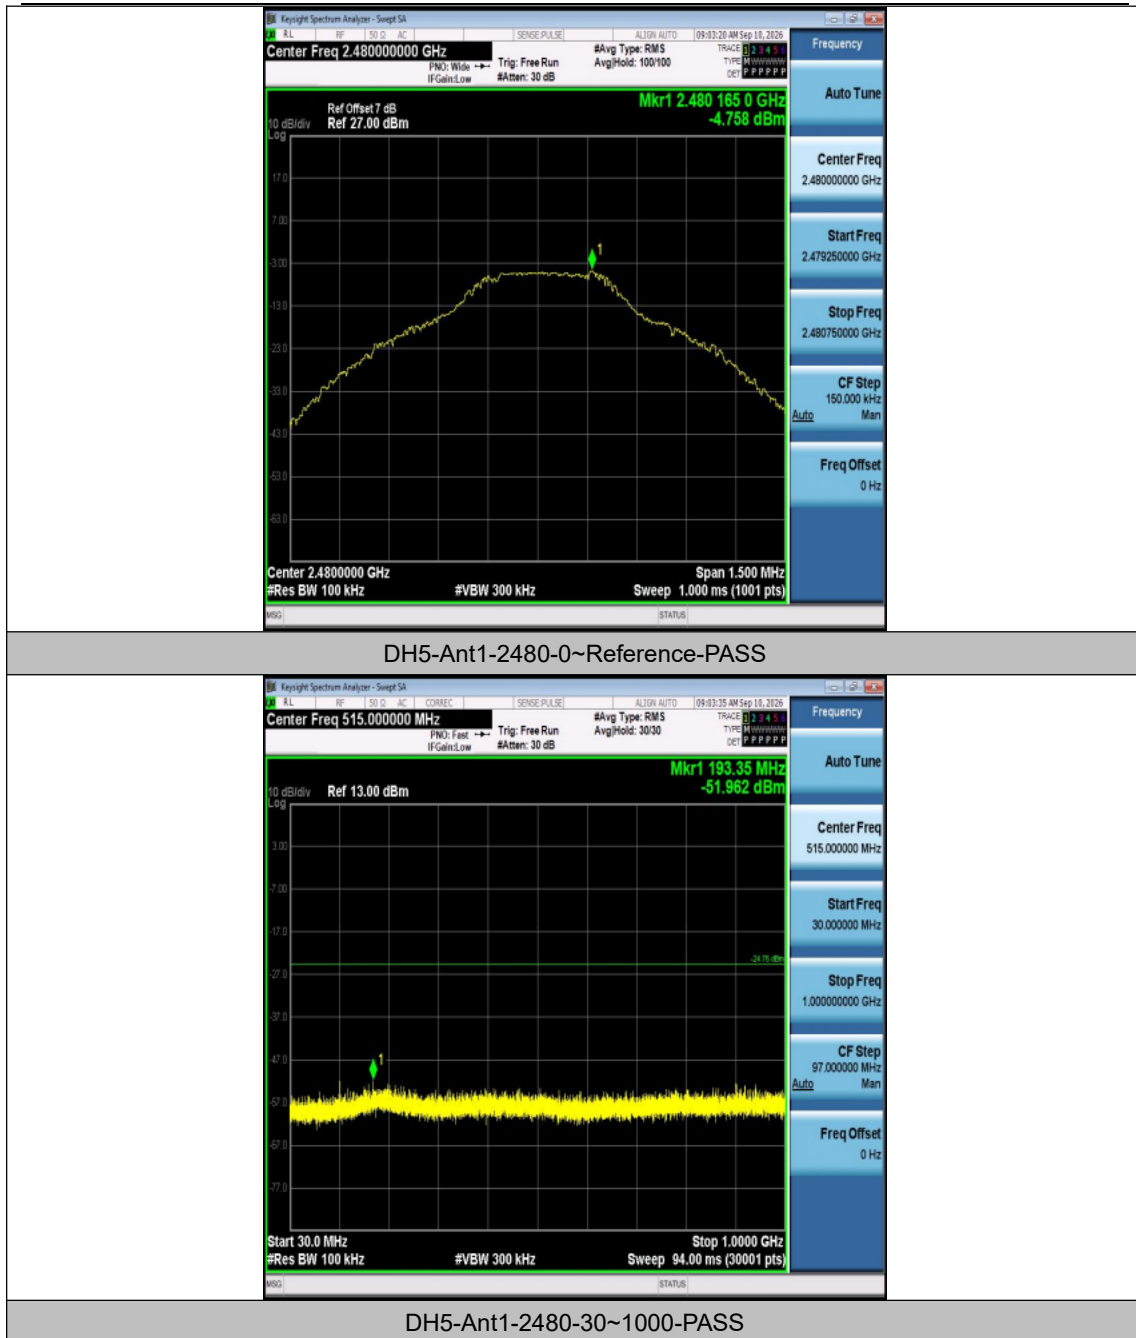

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

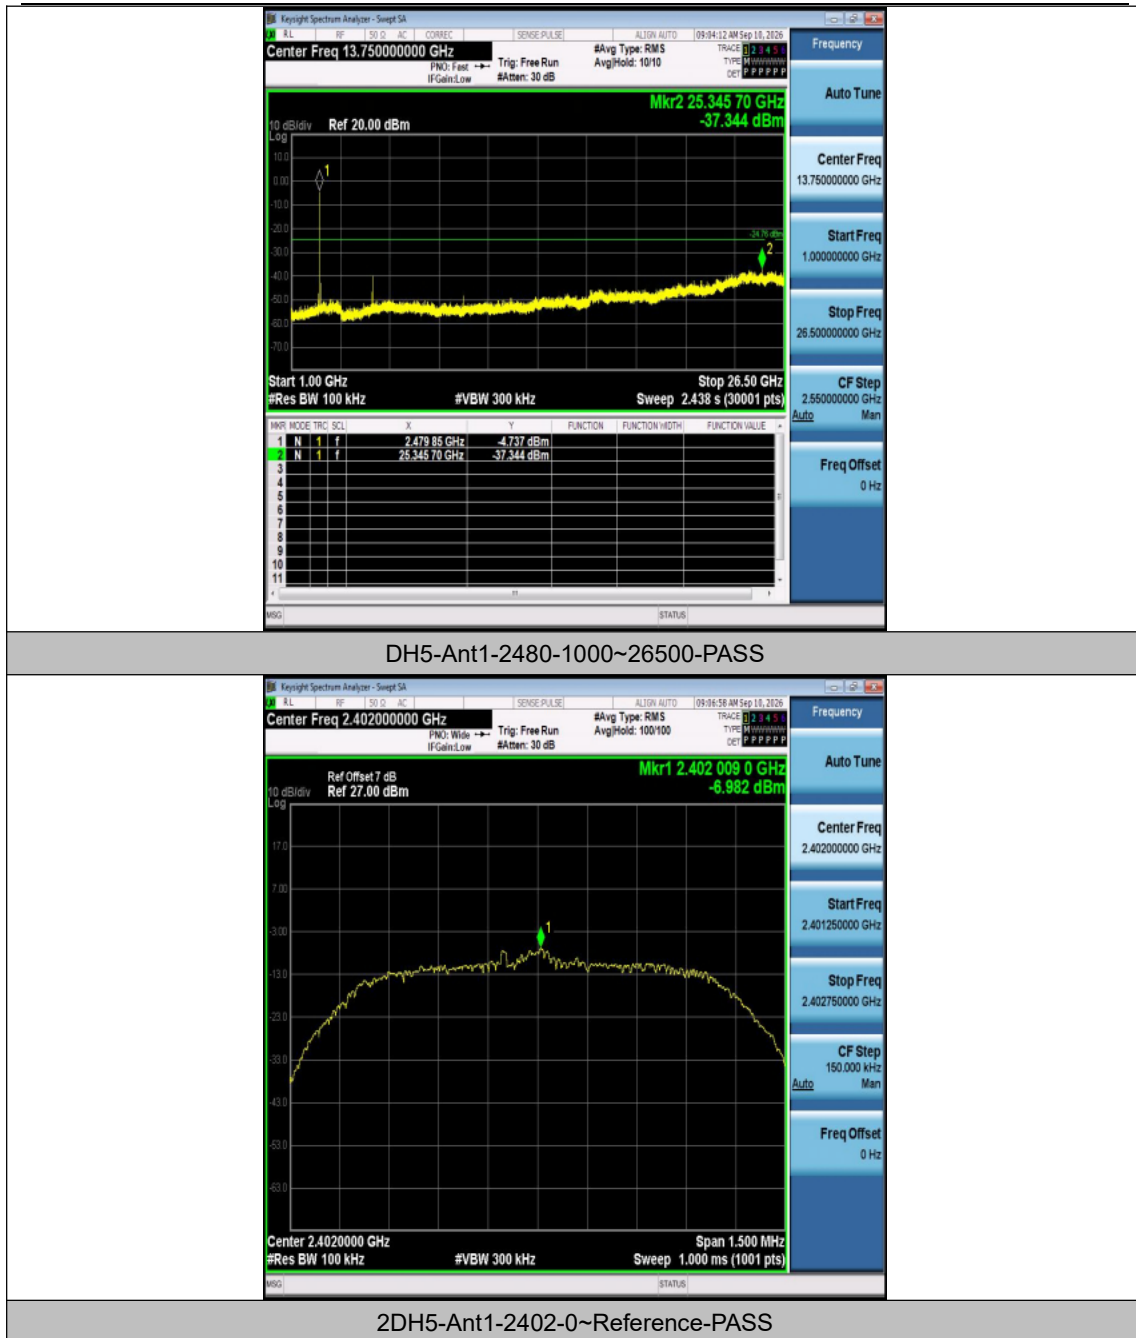


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

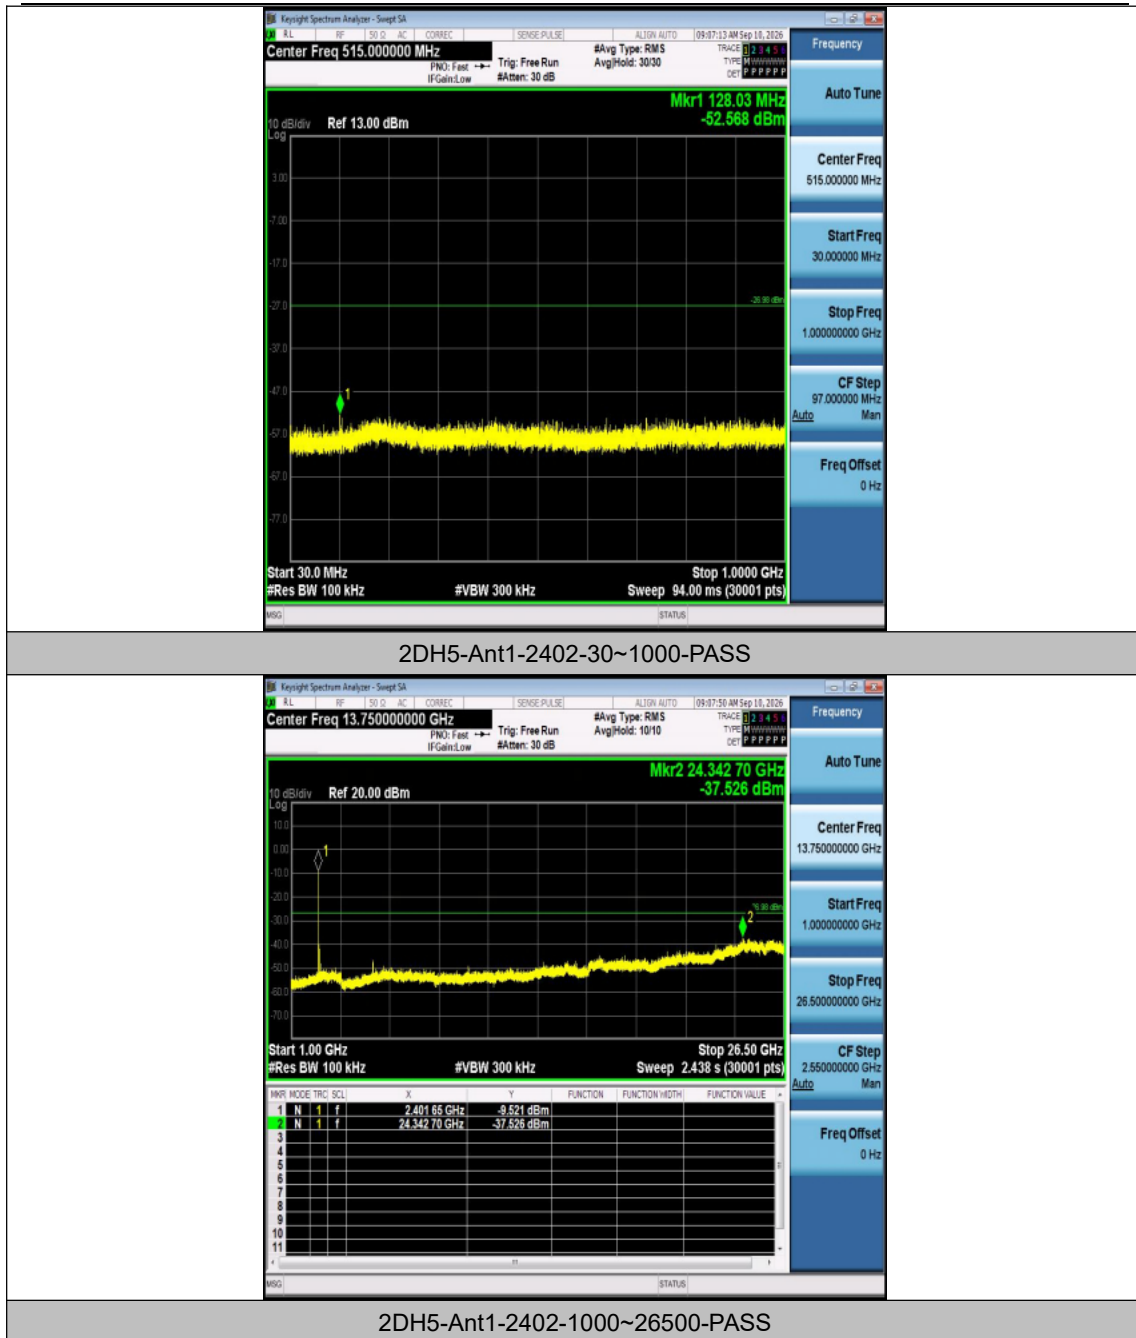


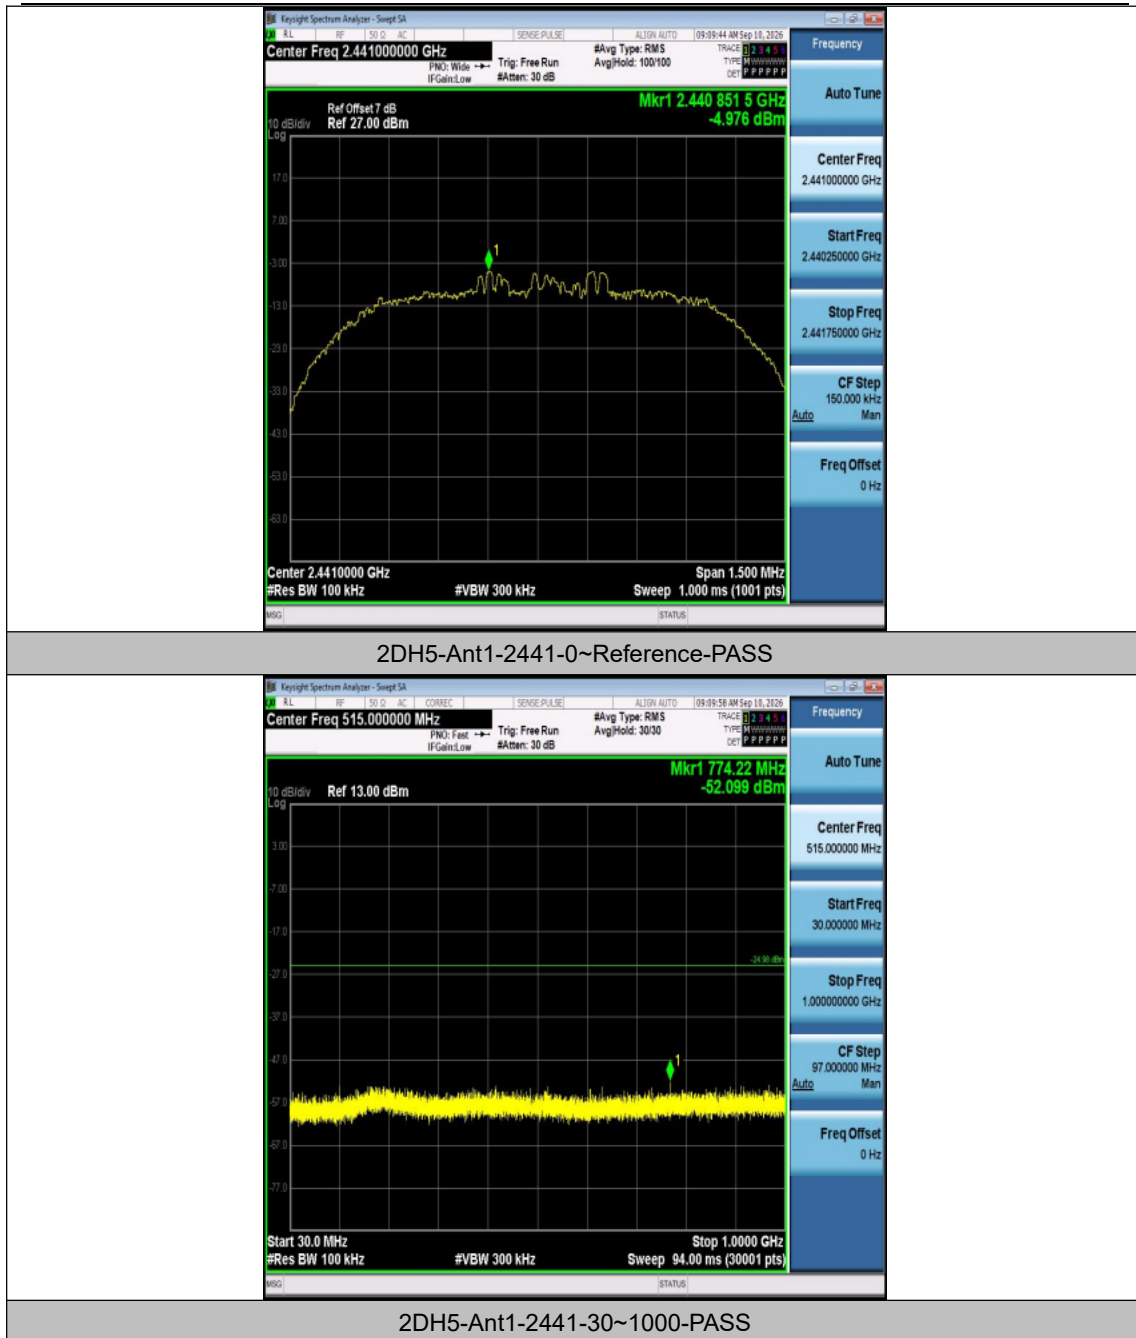

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

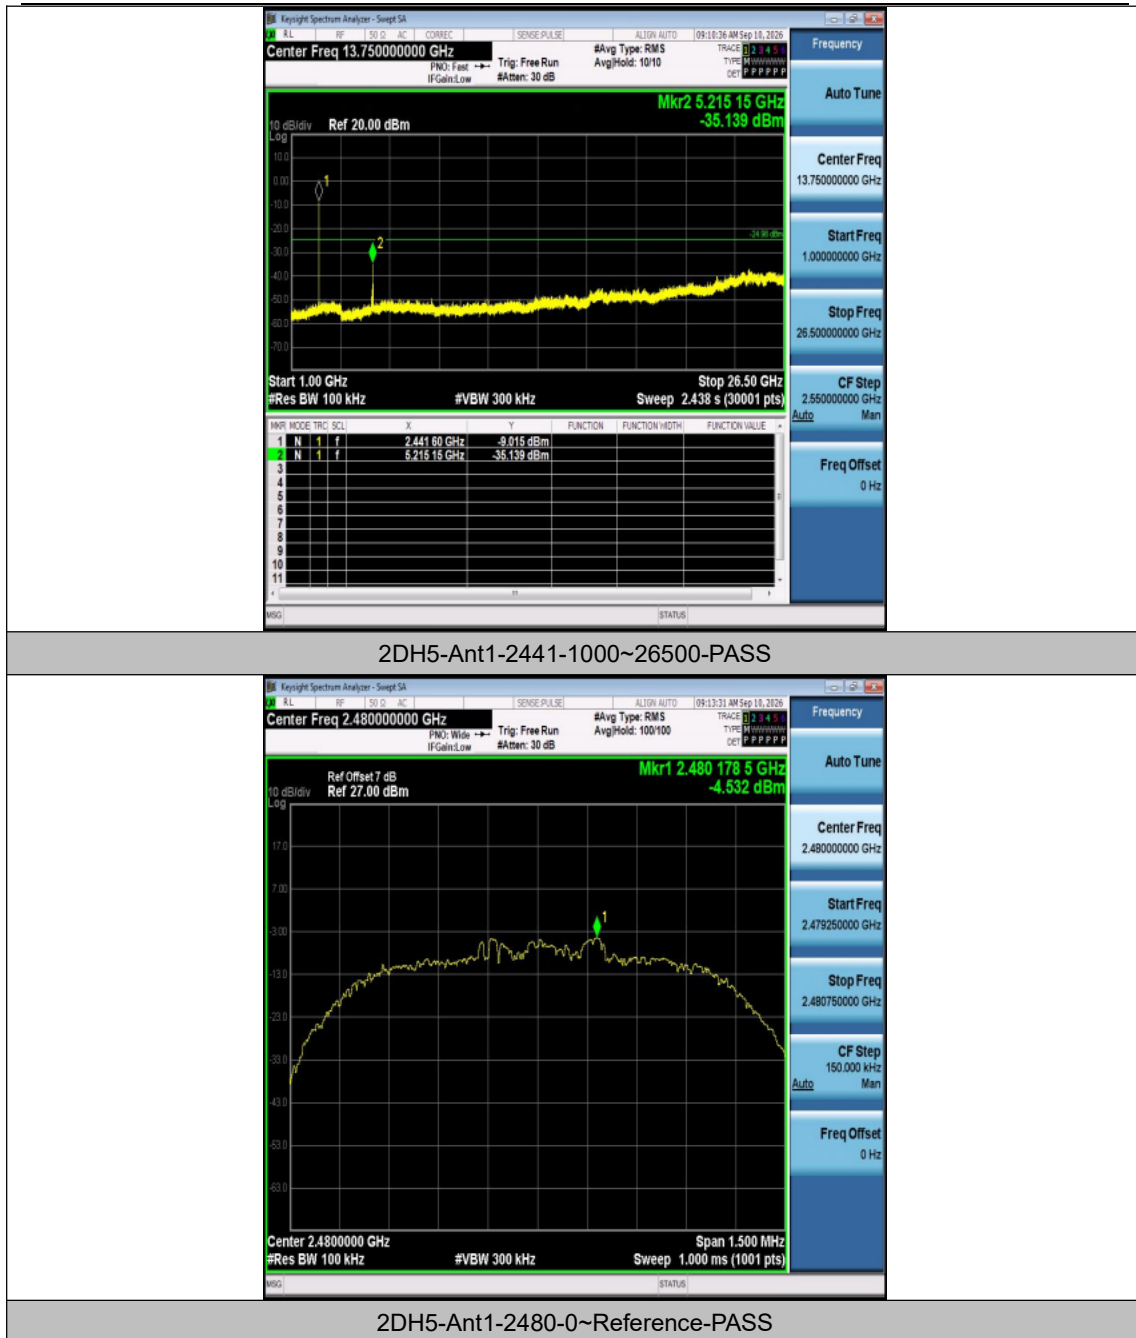


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

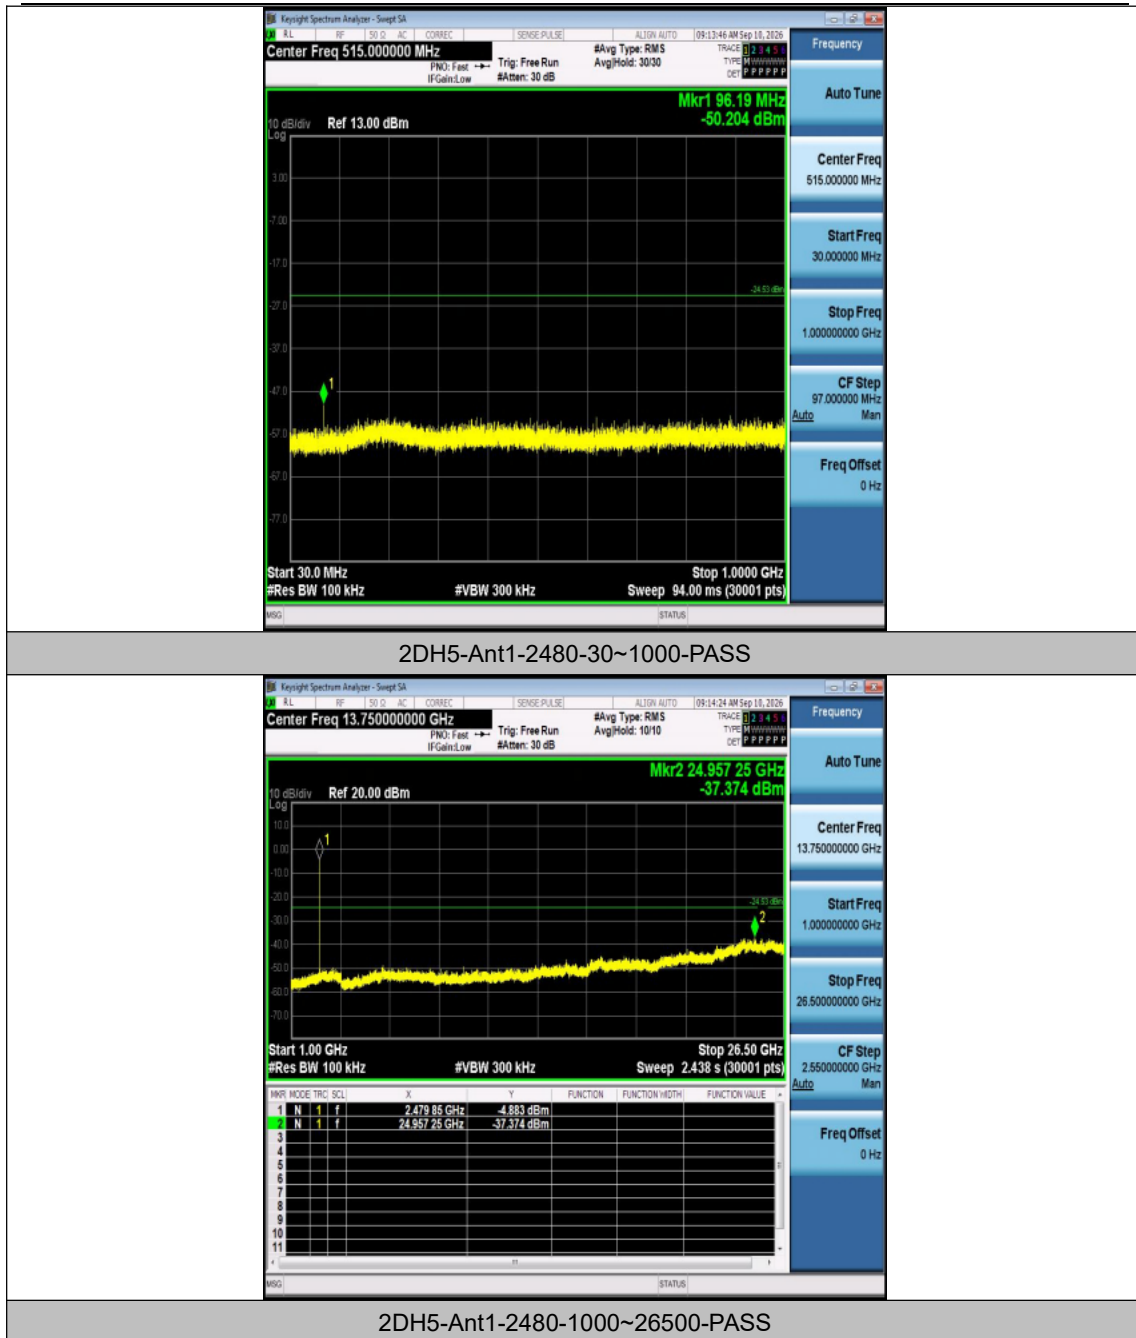


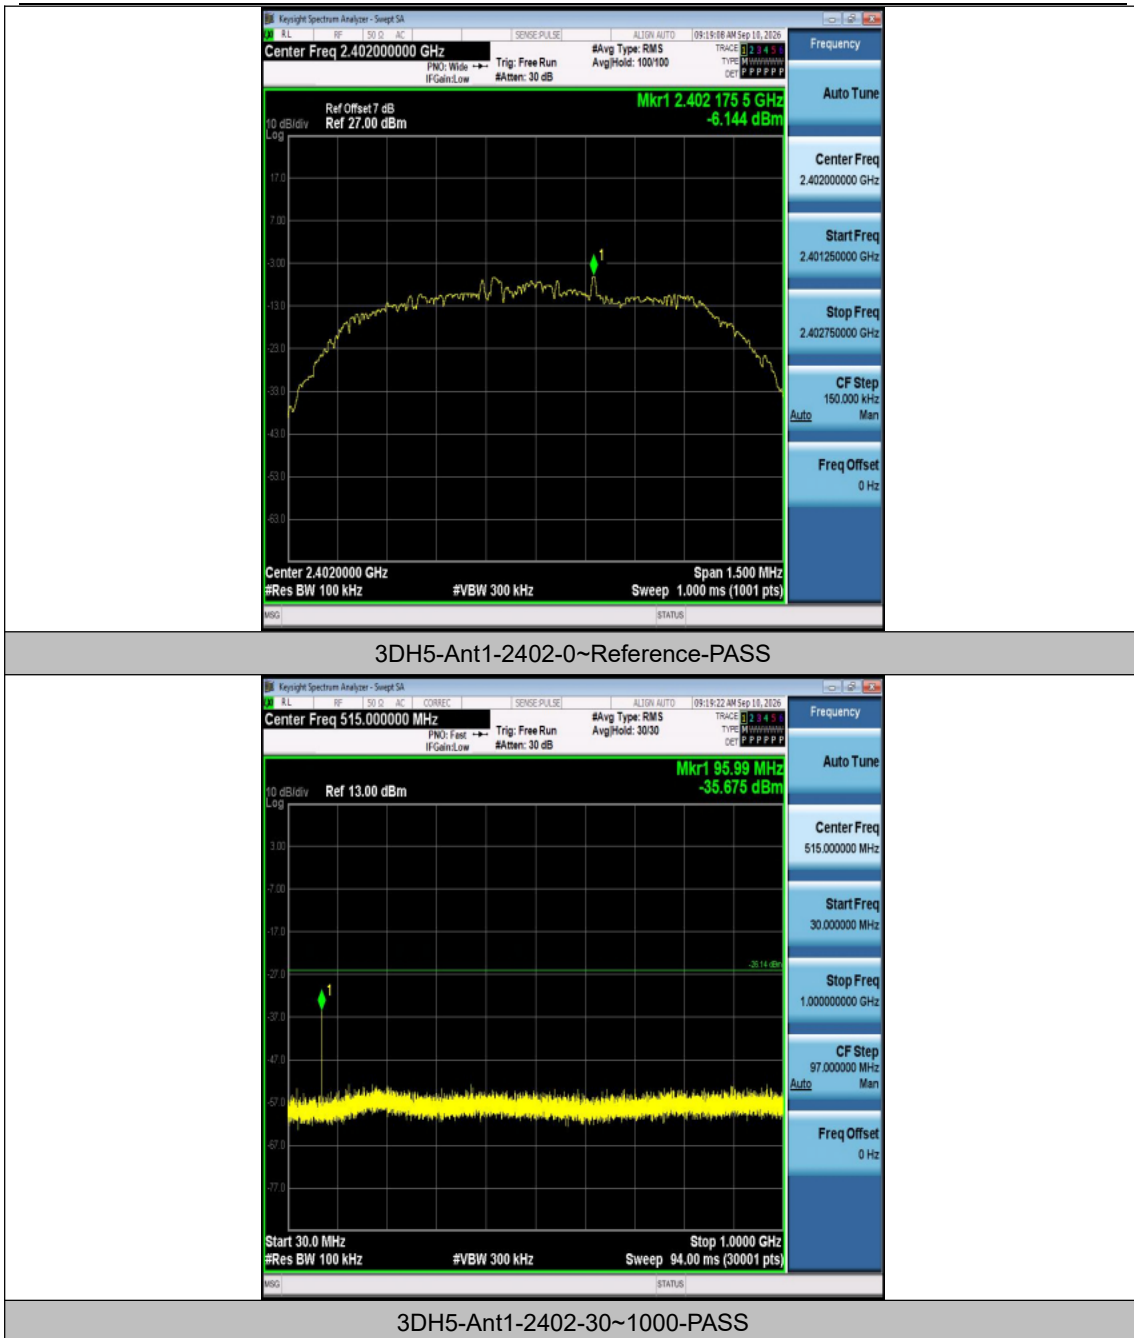

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

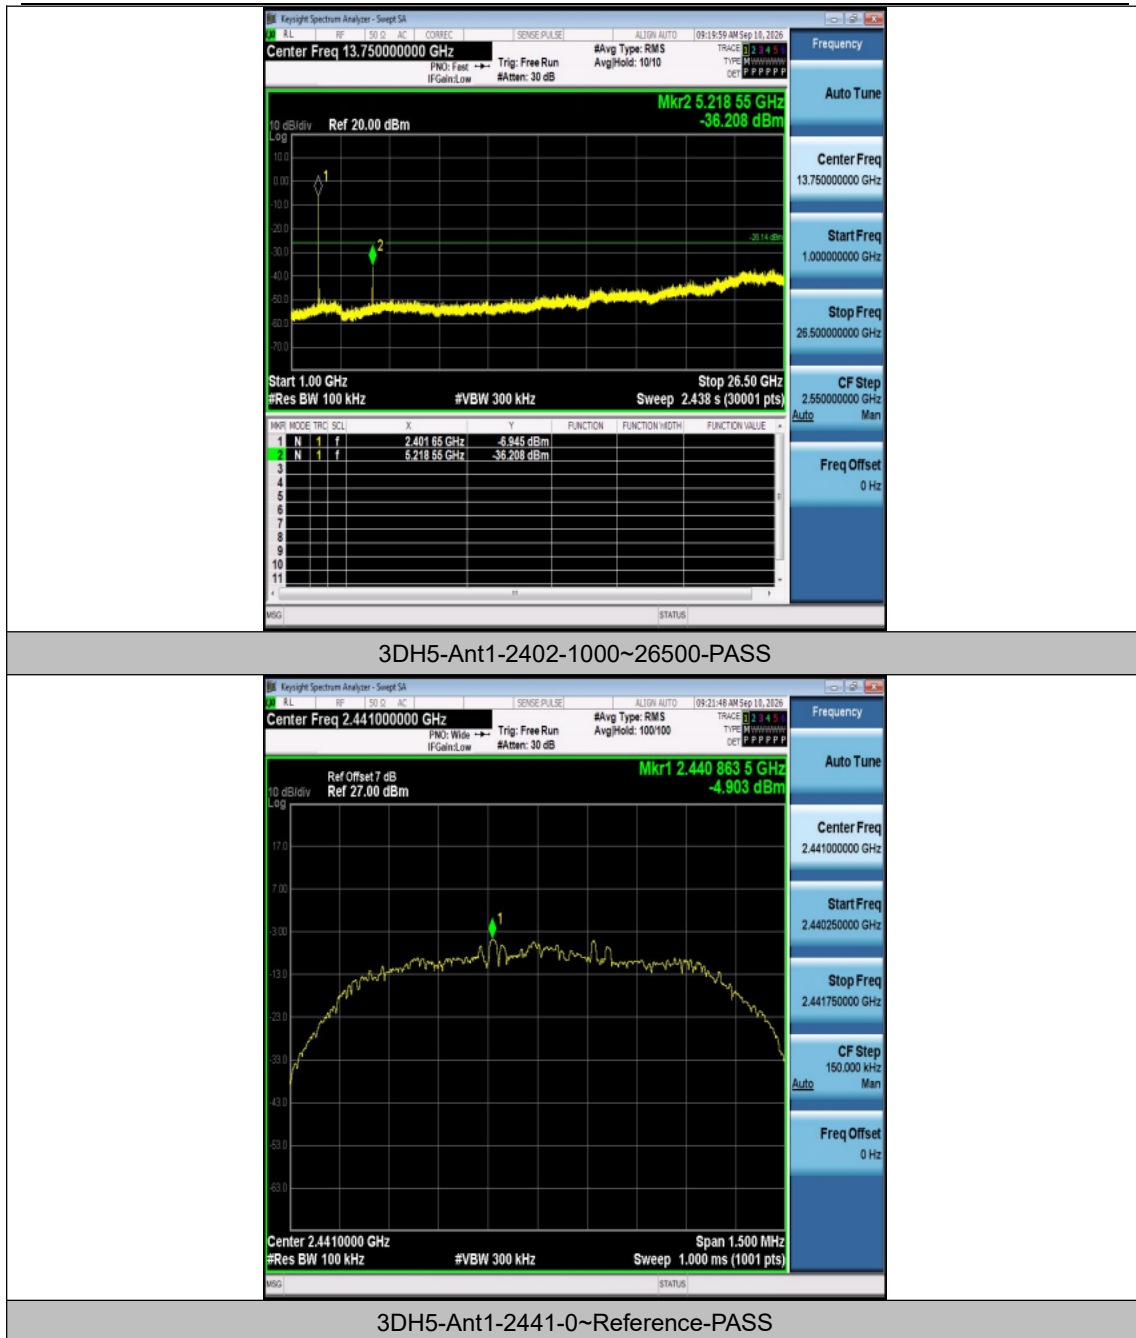


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

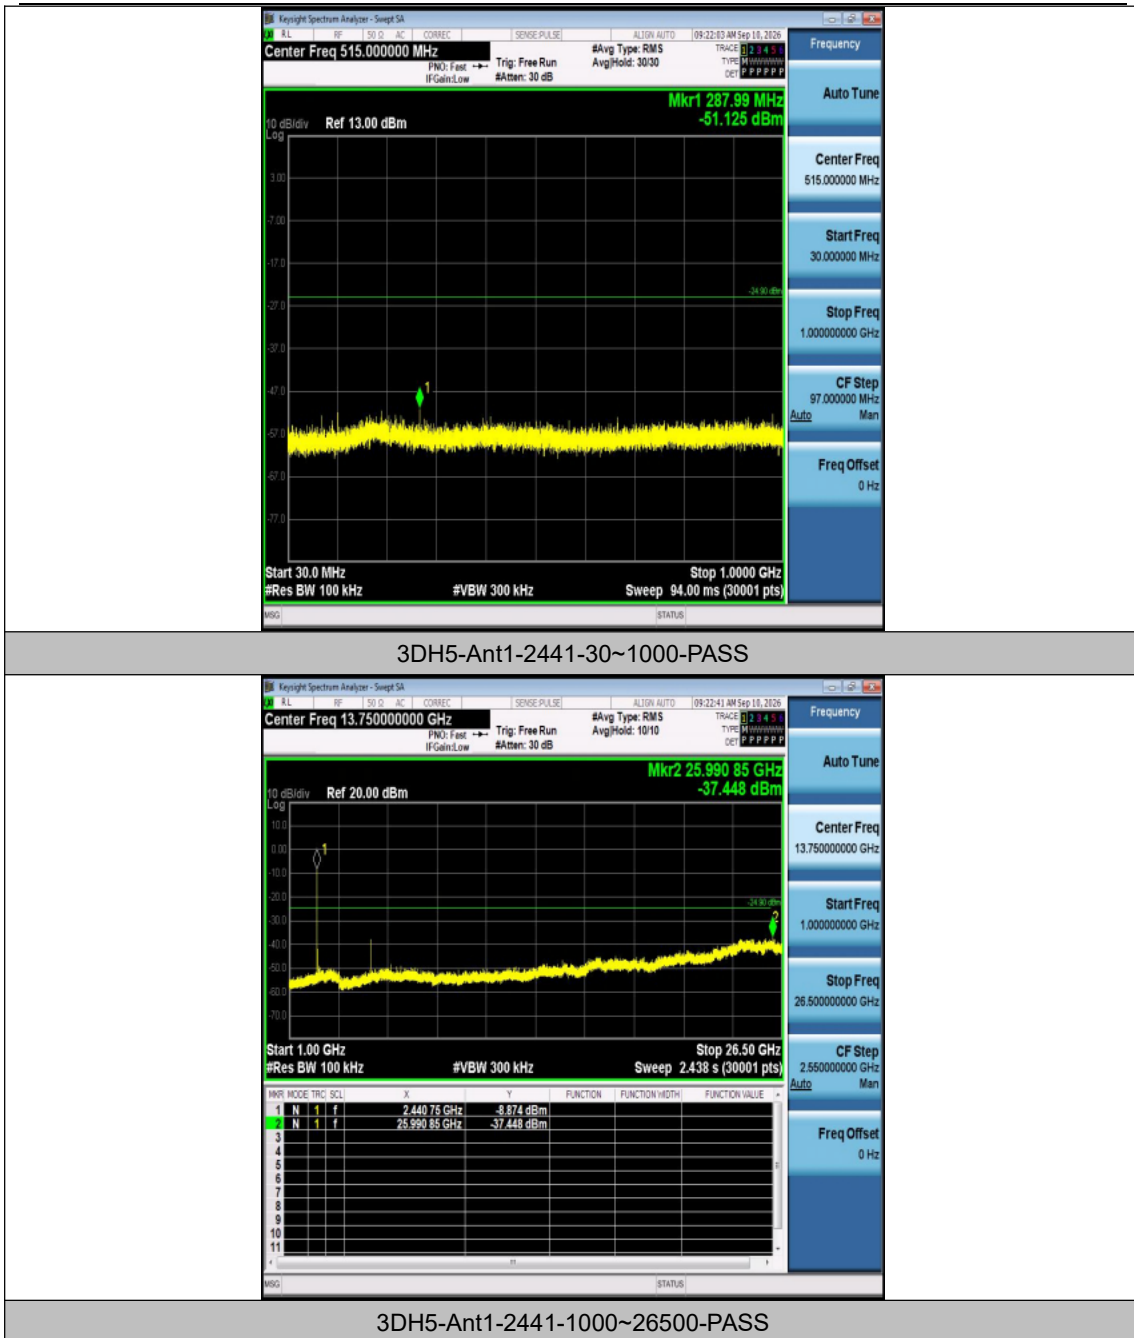


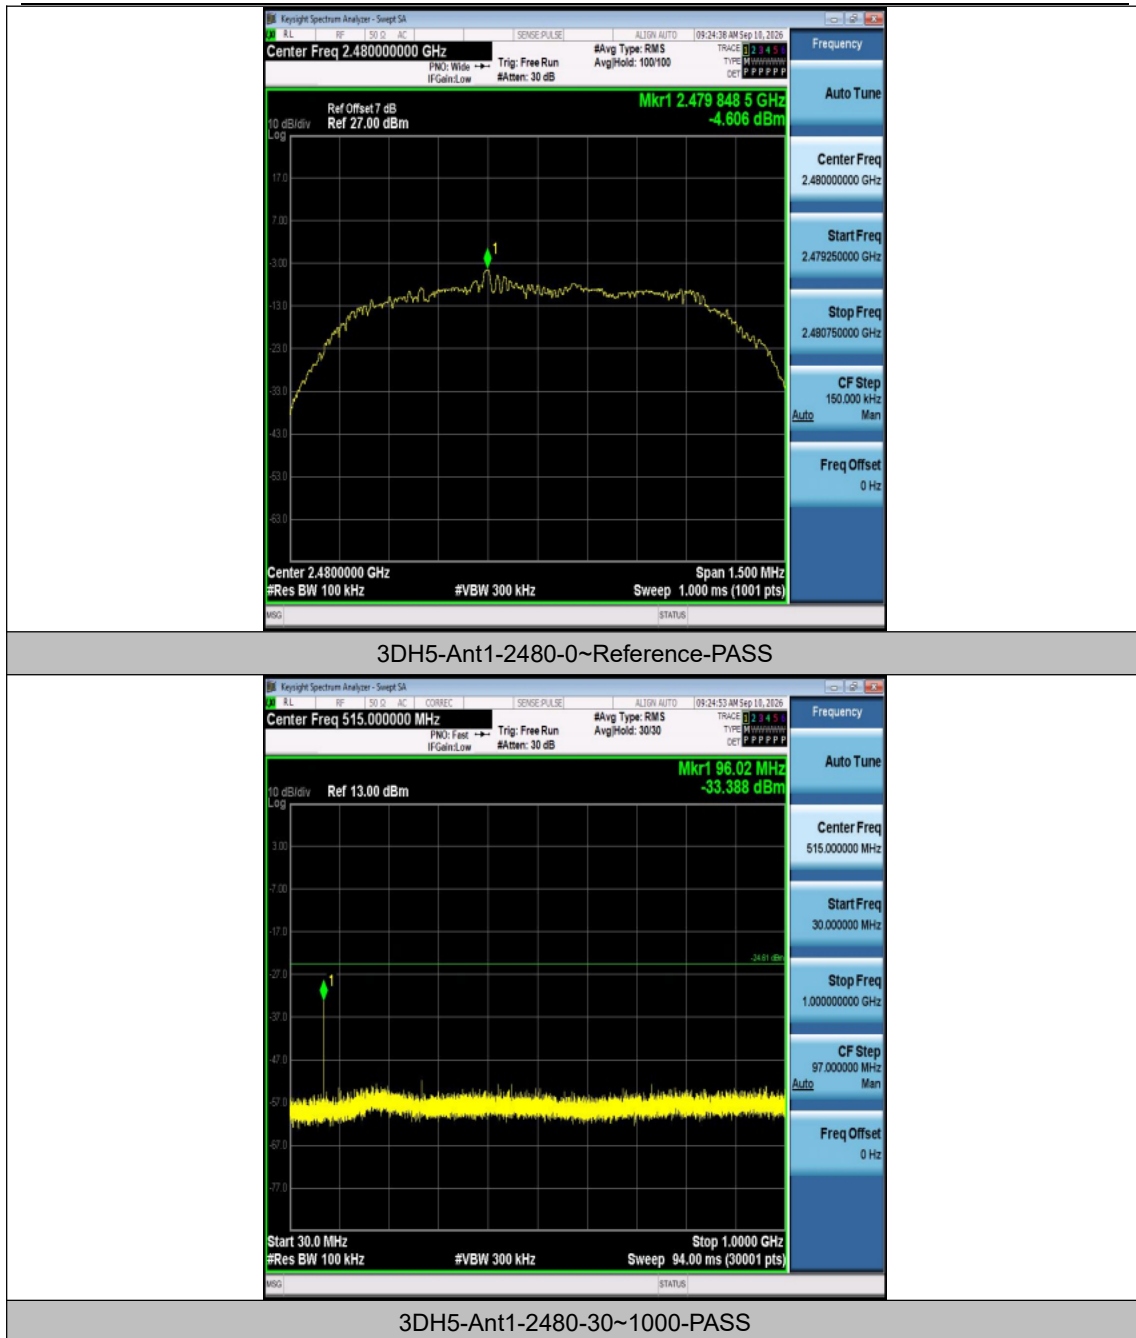

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

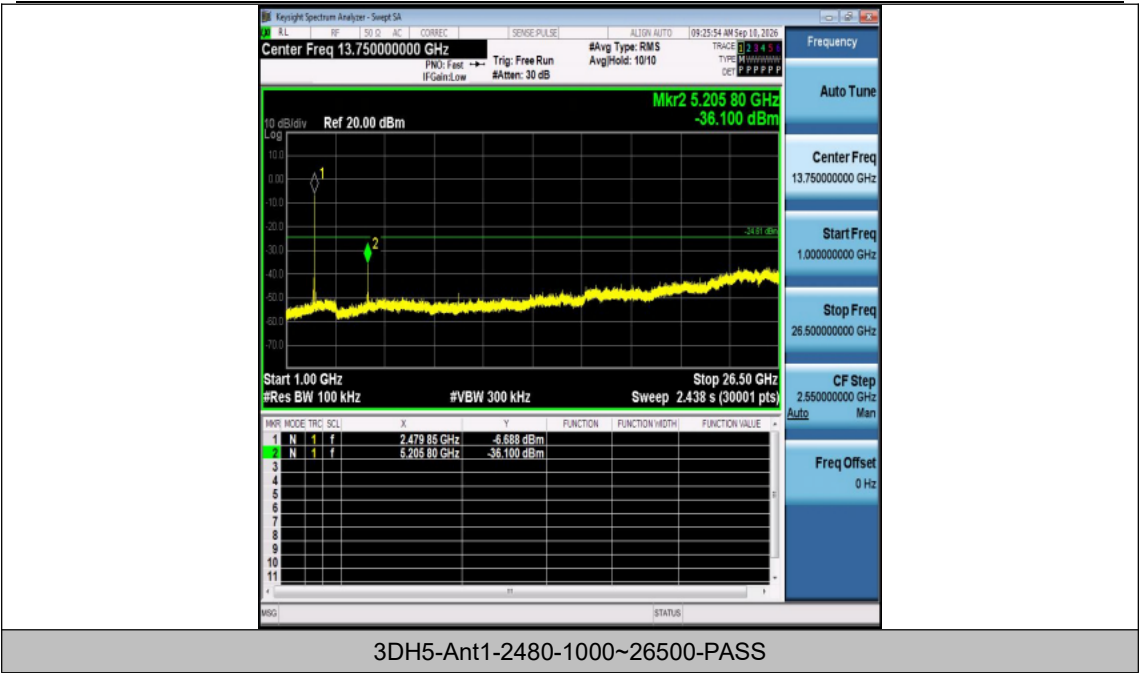

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix I: Duty Cycle


Test Result


Test Mode	Antenna	Frequency[MHz]	ON Time [ms]	Period [ms]	Duty Cycle [%]	Duty Cycle Factor[dB]
DH5	Ant1	2402	2.88	3.76	76.60	1.16
DH5	Ant1	2441	2.88	3.76	76.60	1.16
DH5	Ant1	2480	2.88	3.76	76.60	1.16
2DH5	Ant1	2402	2.88	3.76	76.60	1.16
2DH5	Ant1	2441	2.88	3.74	77.01	1.13
2DH5	Ant1	2480	2.88	3.76	76.60	1.16
3DH5	Ant1	2402	2.88	3.74	77.01	1.13
3DH5	Ant1	2441	2.88	3.74	77.01	1.13
3DH5	Ant1	2480	2.88	3.74	77.01	1.13


Test Graphs

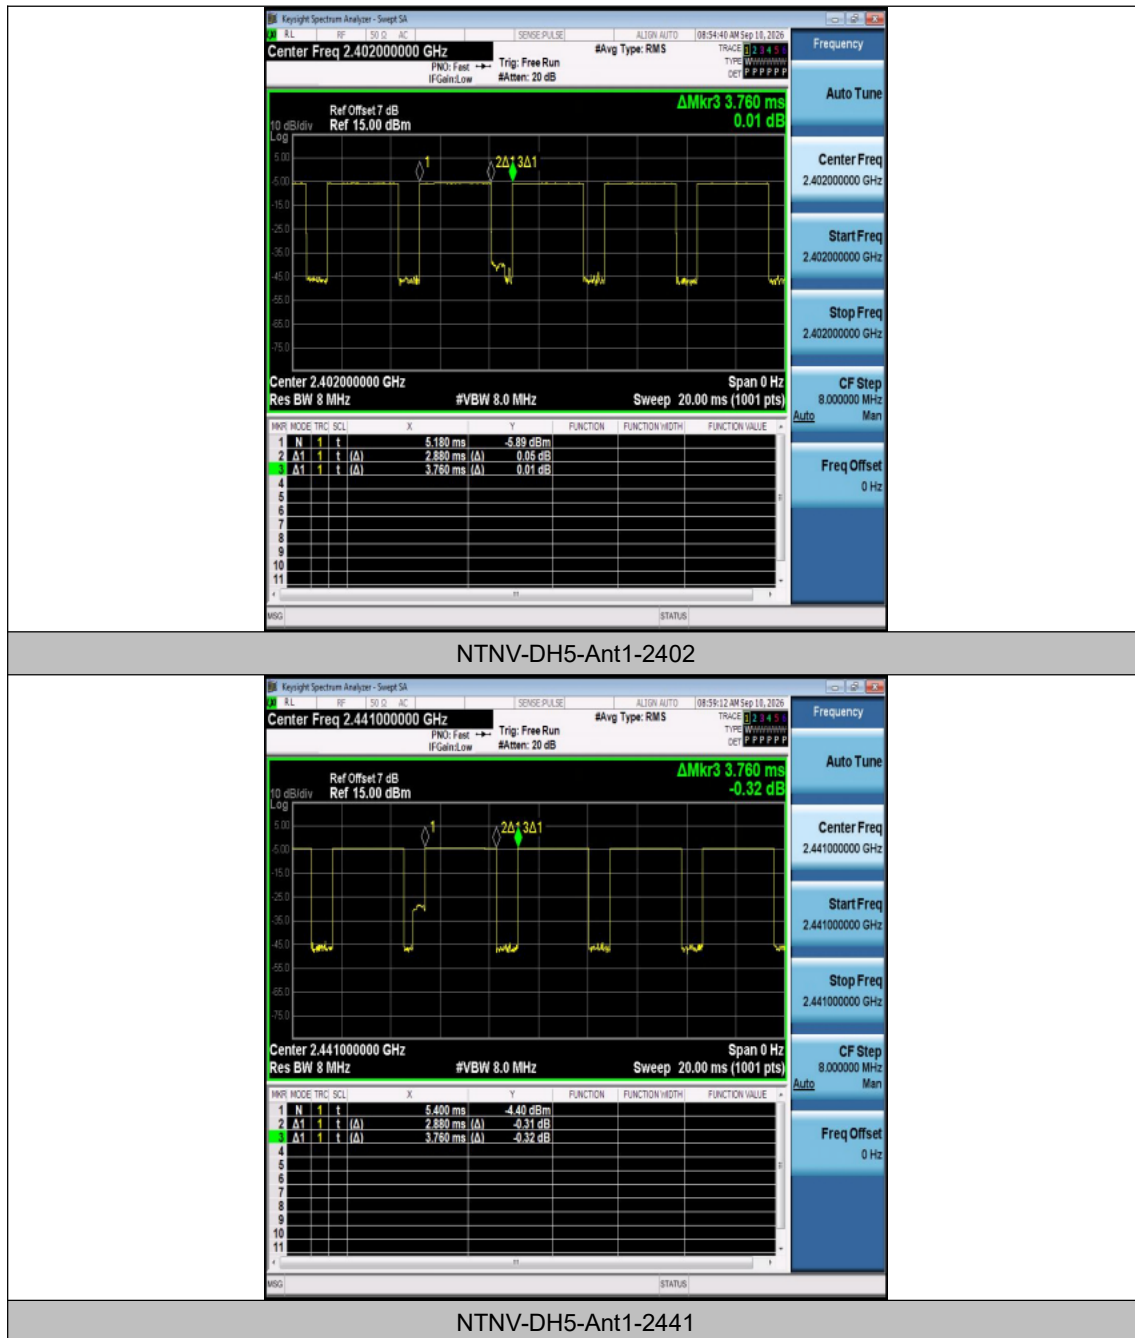

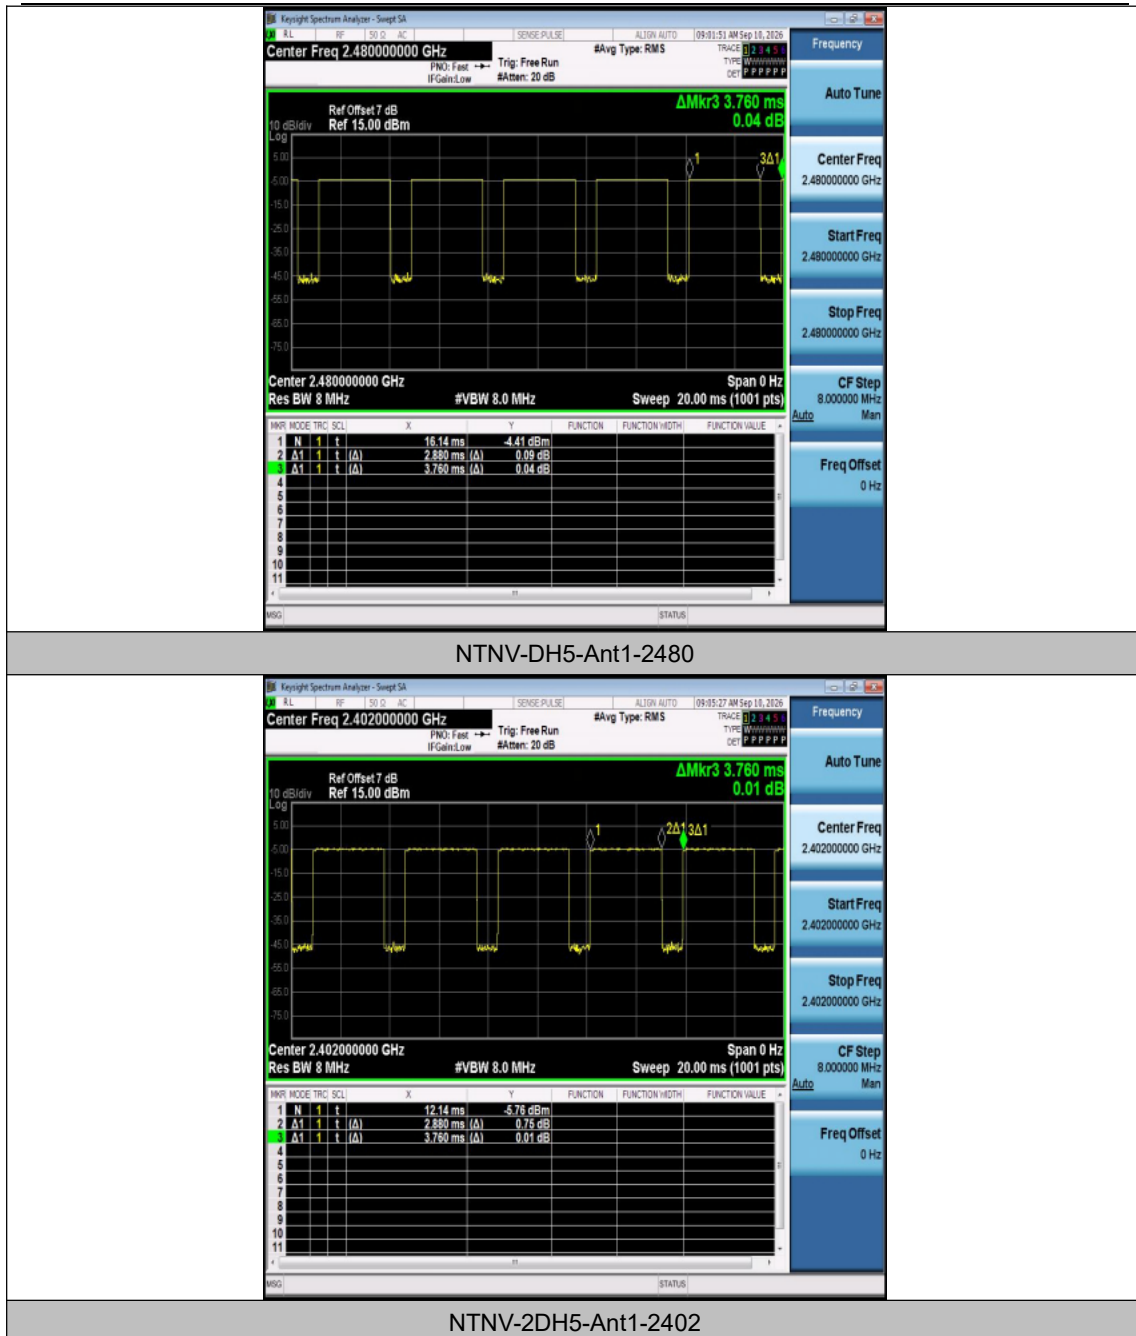

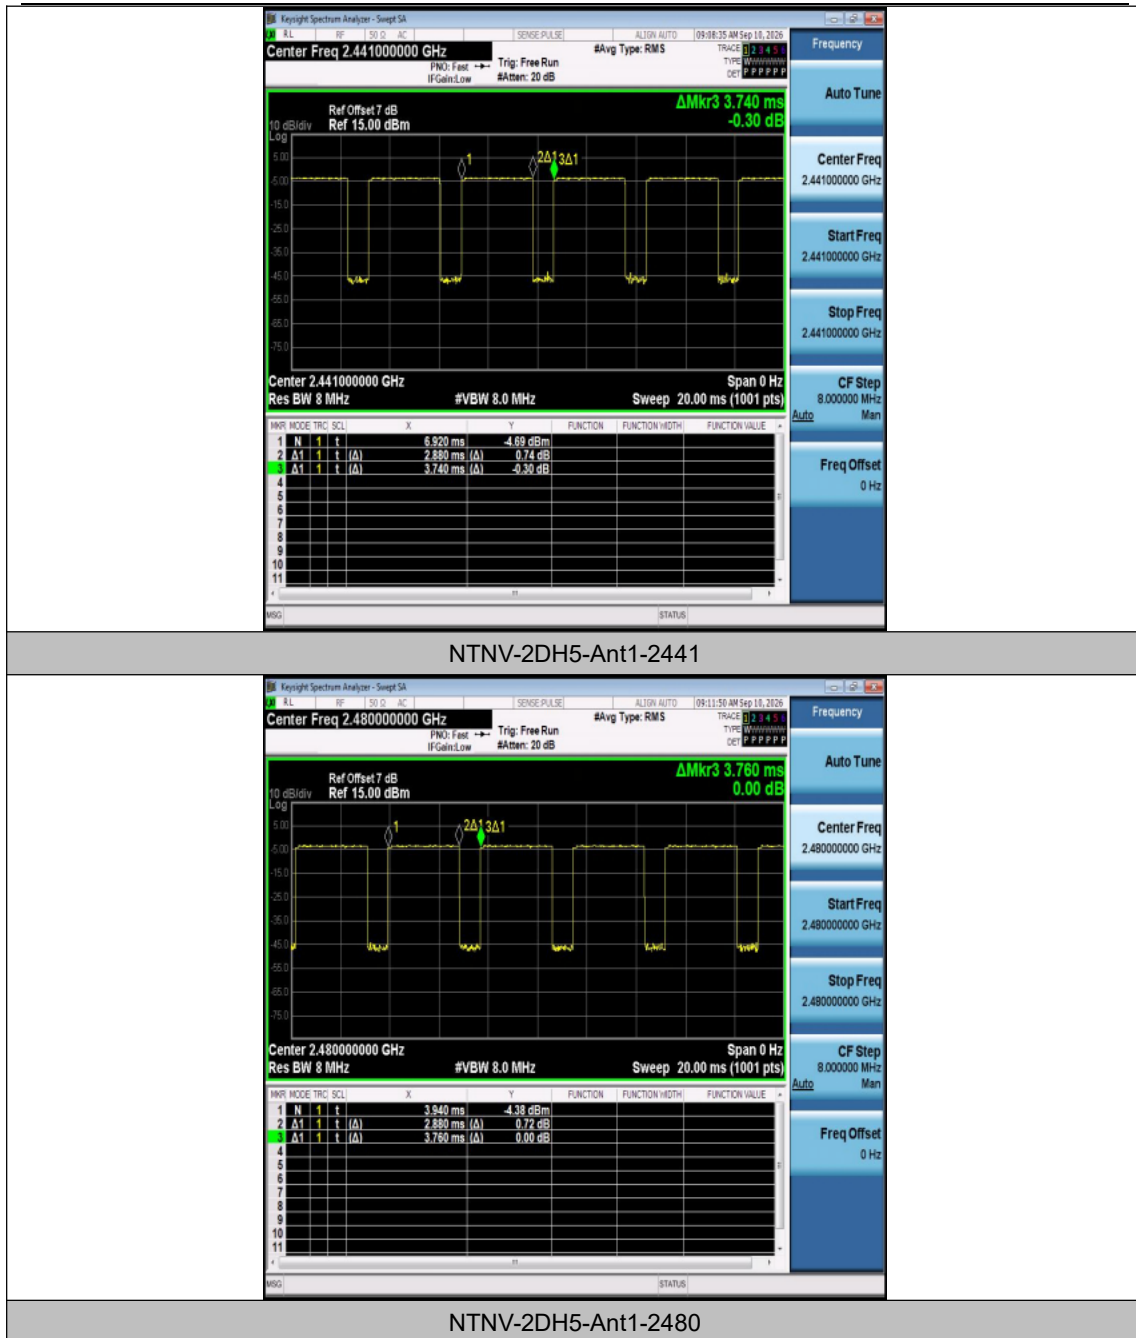

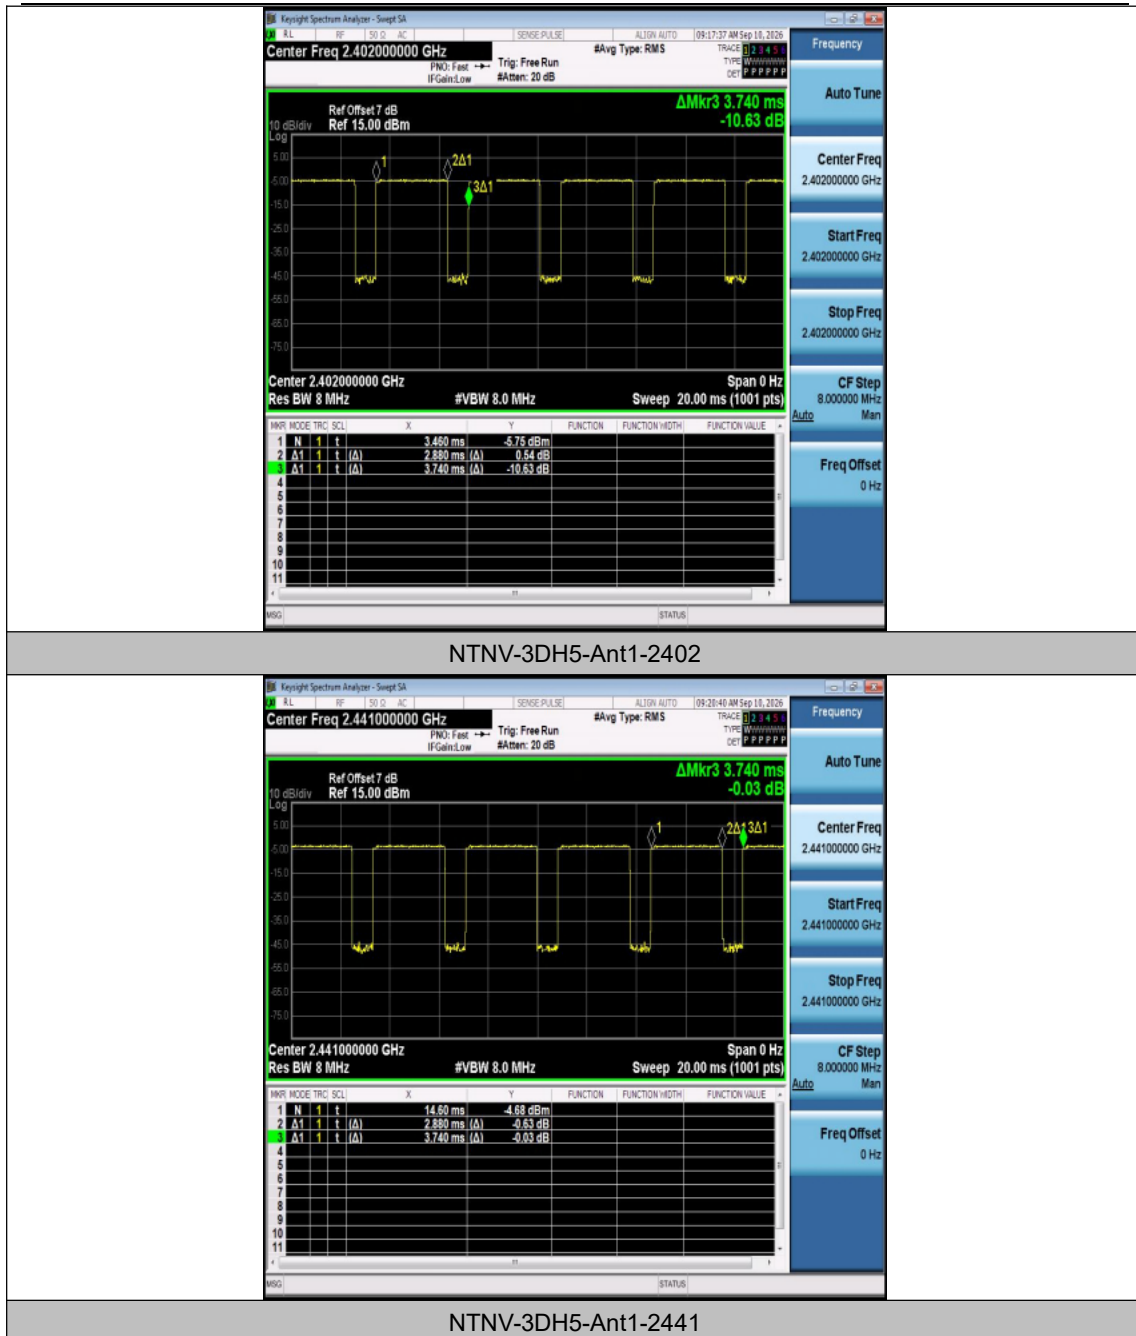

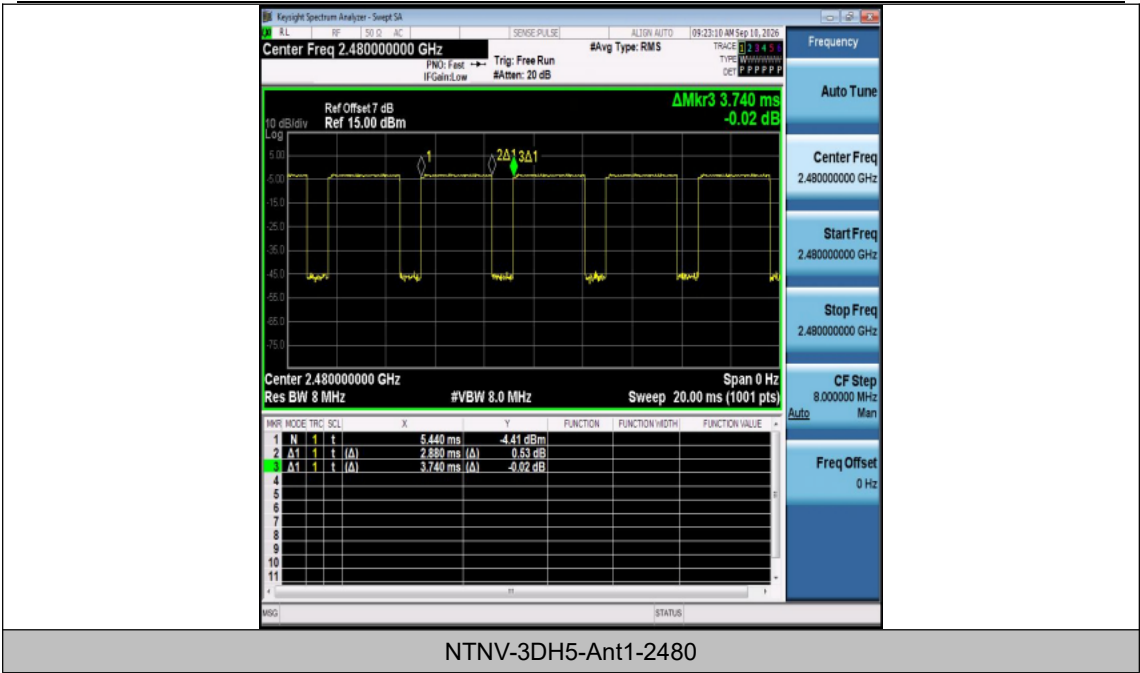

NTNV-3DH5-Ant1-2480

---End---