


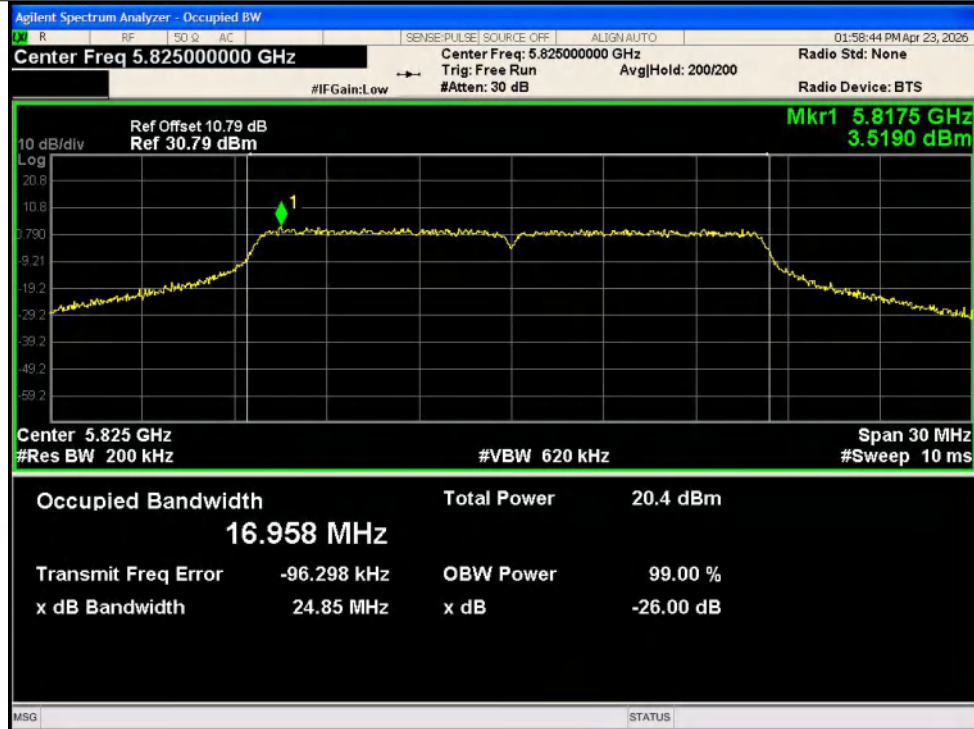


OBW NVNT a 5825MHz

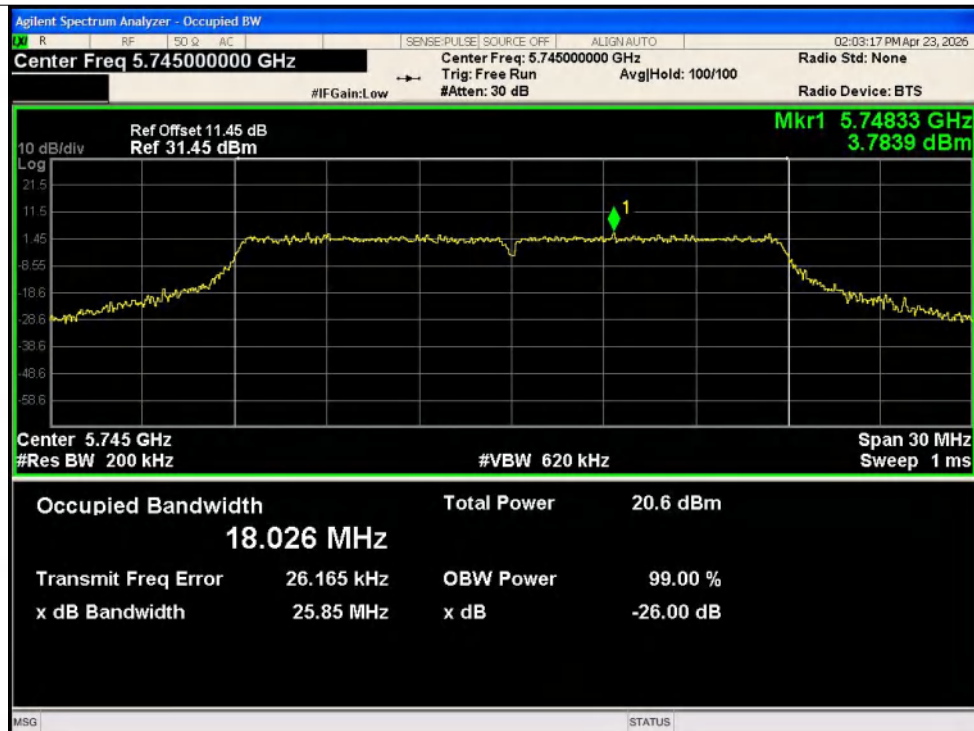


OBW NVNT n20 5745MHz

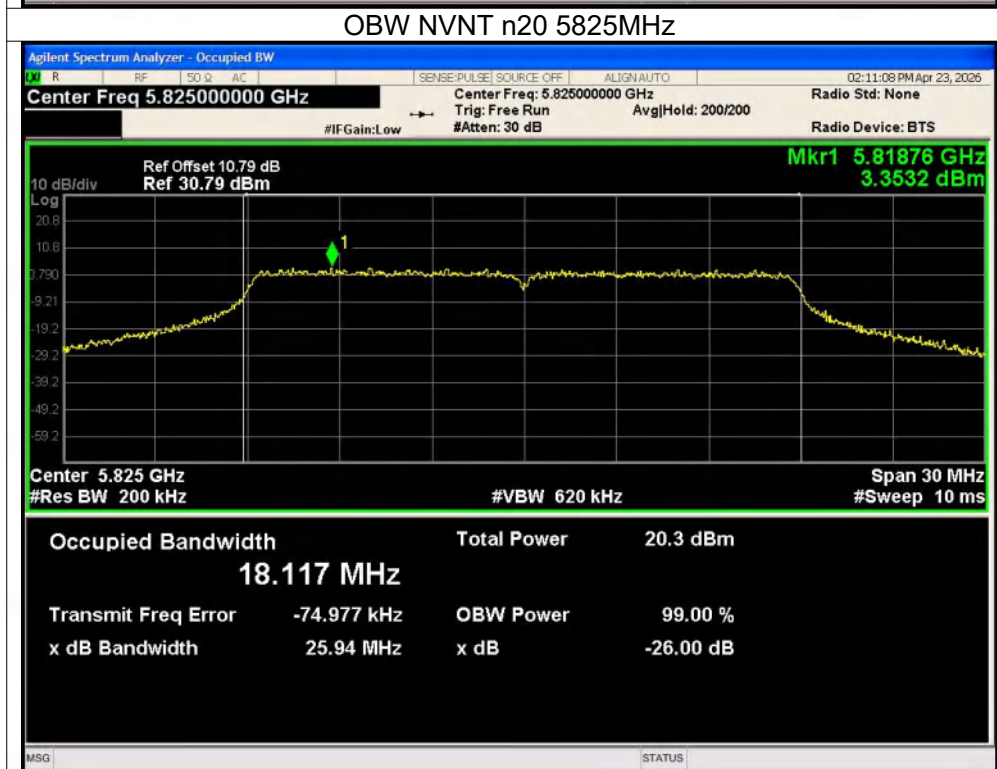


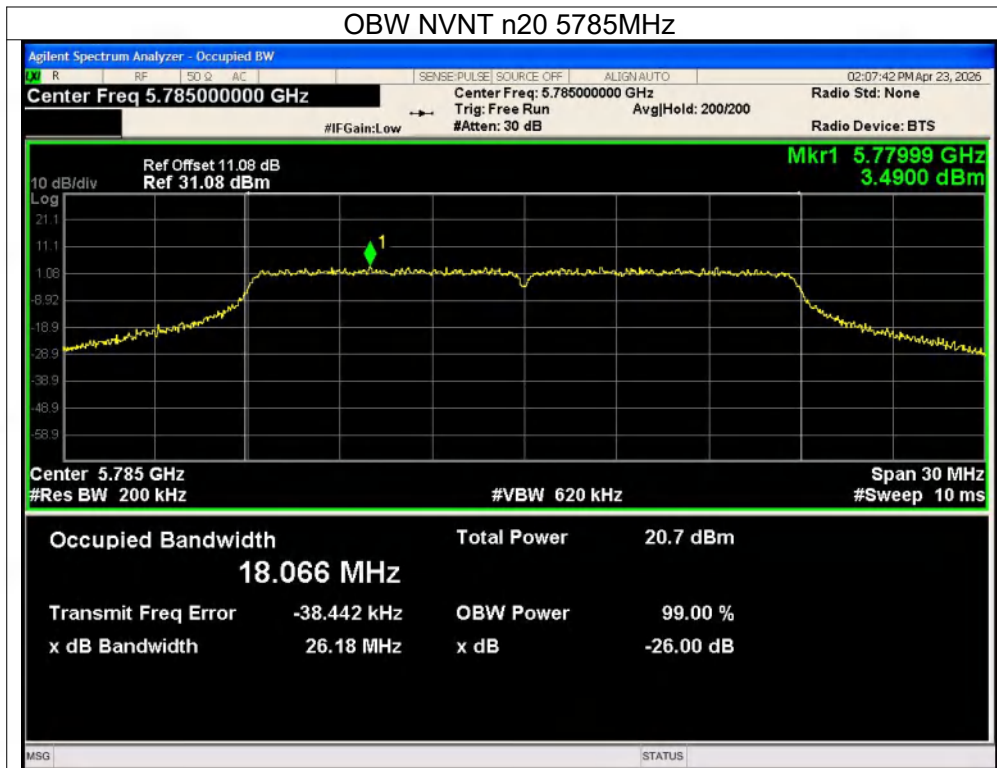


OBW NVNT n40 5755MHz

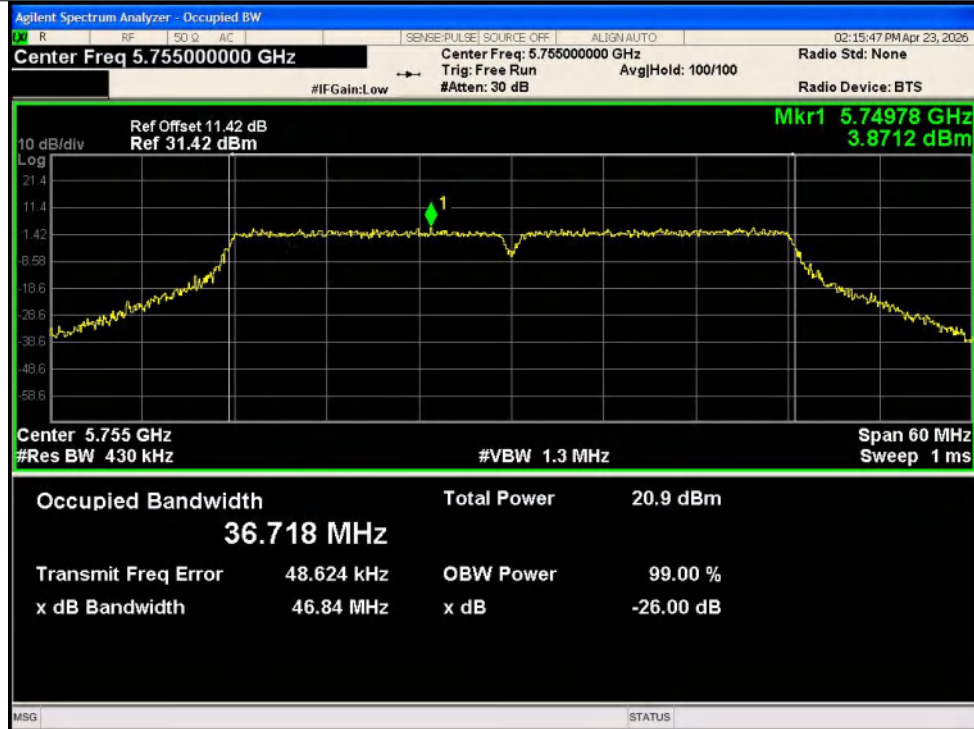


OBW NVNT n40 5795MHz

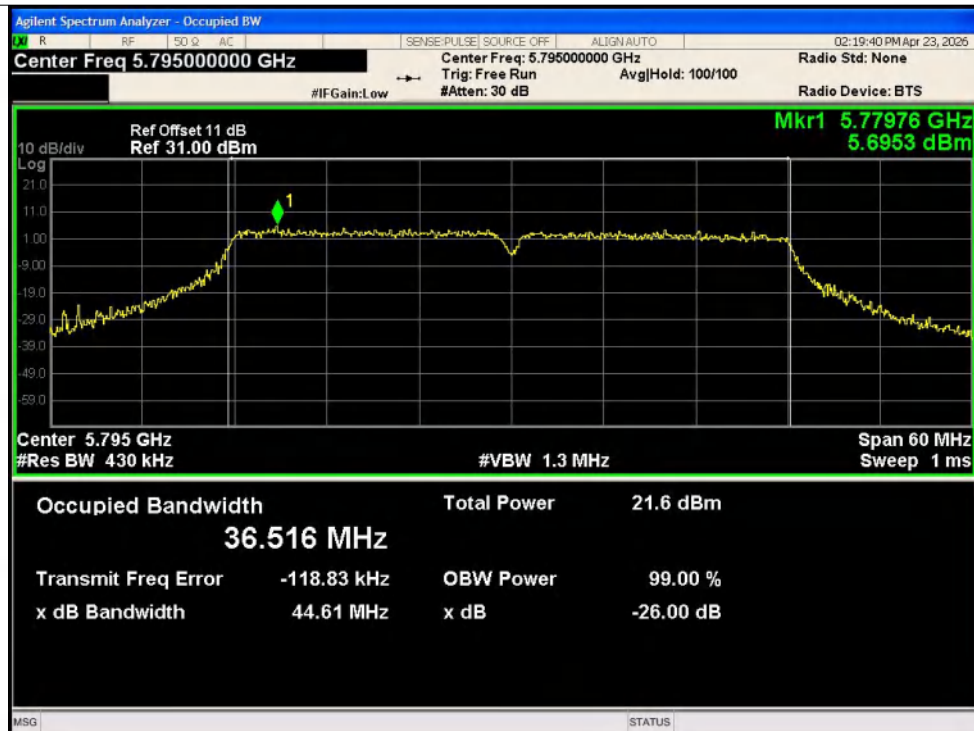


OBW NVNT ac20 5745MHz

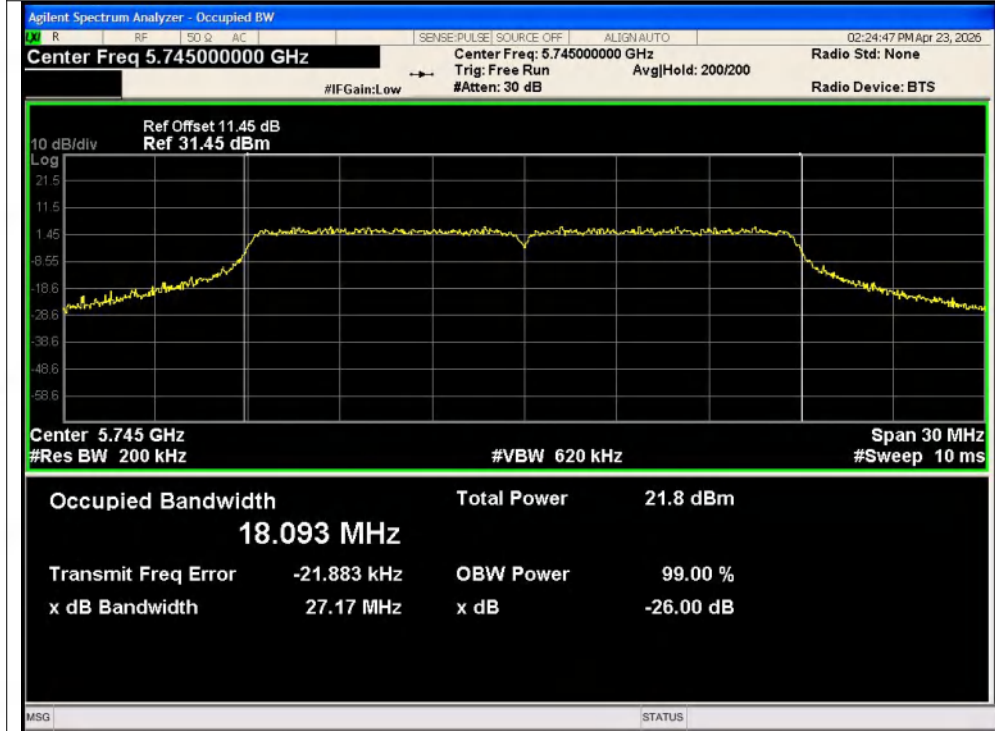

OBW NVNT ac20 5785MHz

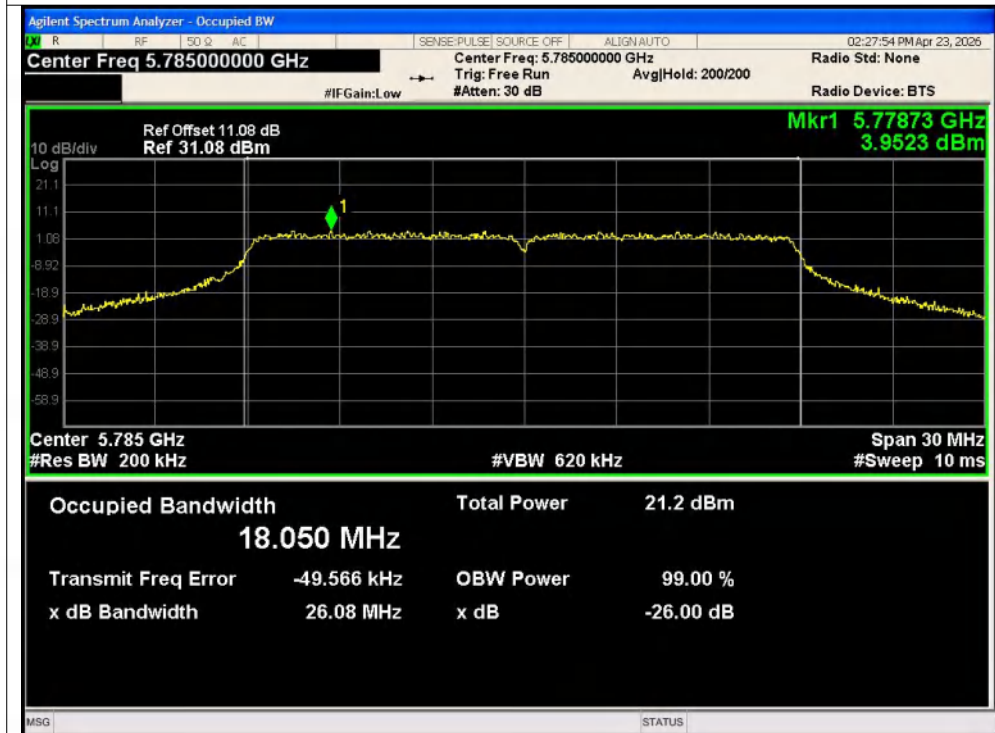


OBW NVNT ac20 5825MHz

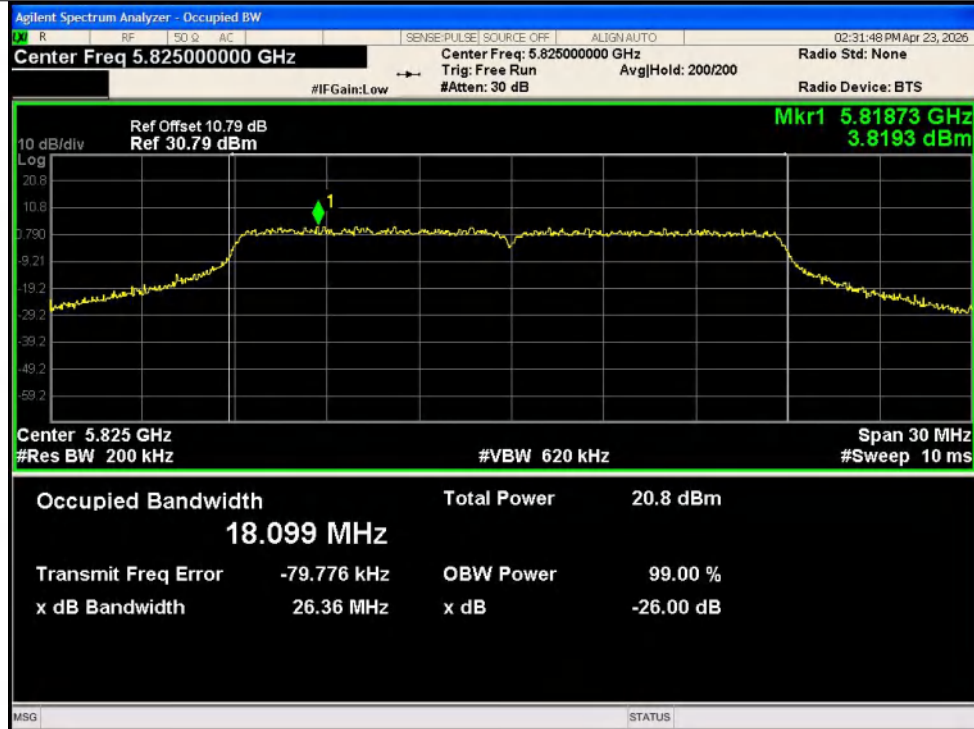


OBW NVNT ac40 5755MHz




OBW NVNT ac40 5795MHz

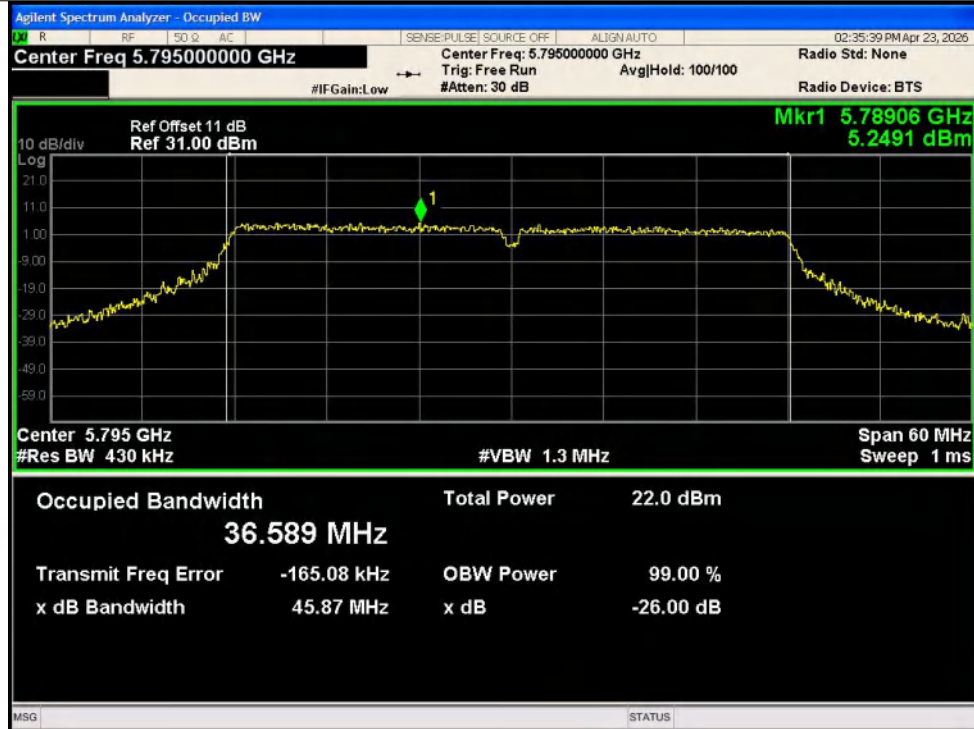


OBW NVNT ax20 5745MHz

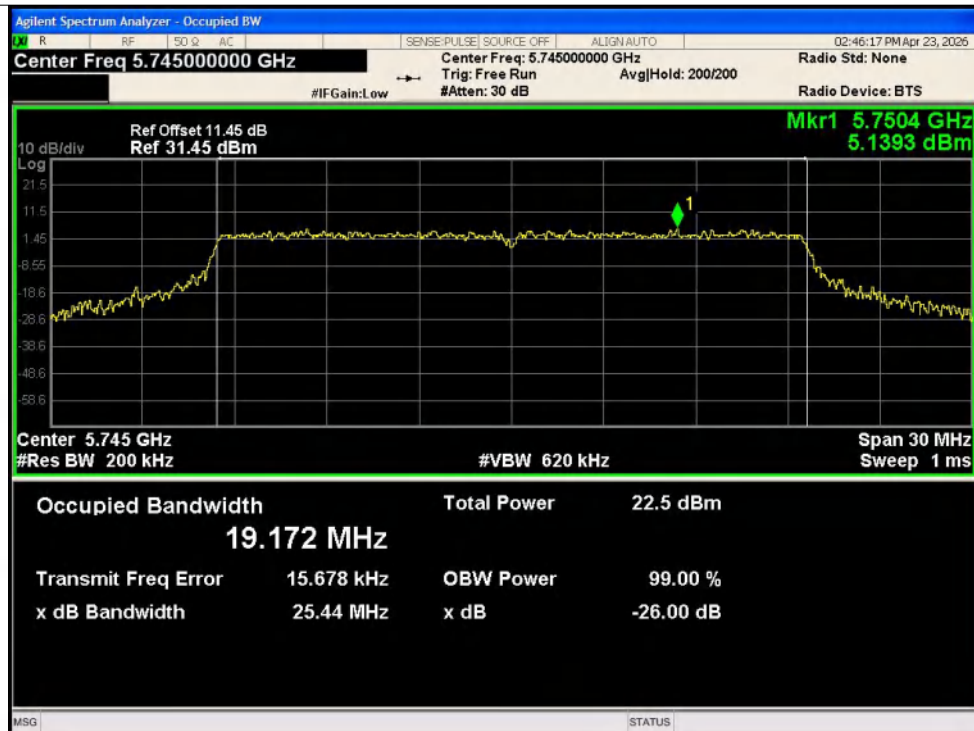


OBW NVNT ax20 5785MHz

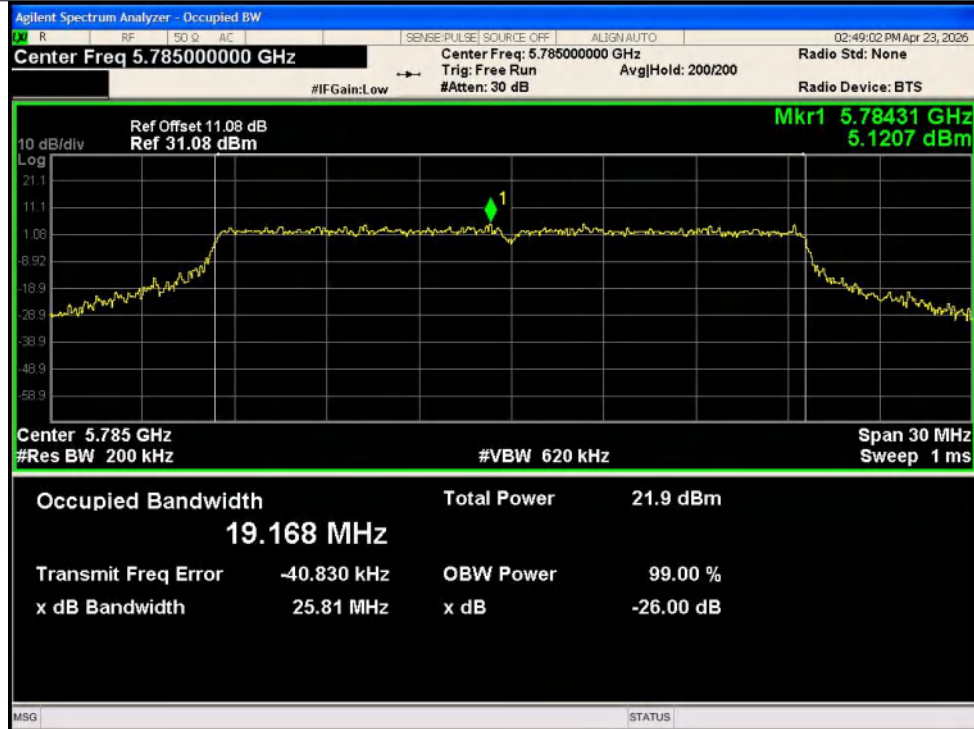


OBW NVNT ax20 5825MHz

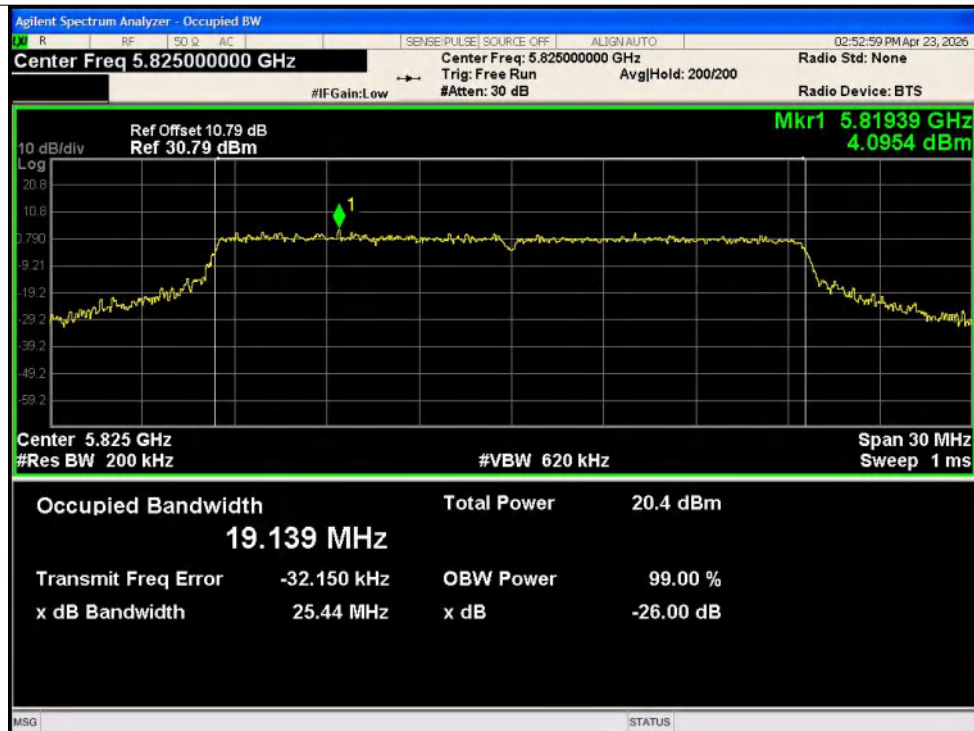

OBW NVNT ax40 5755MHz

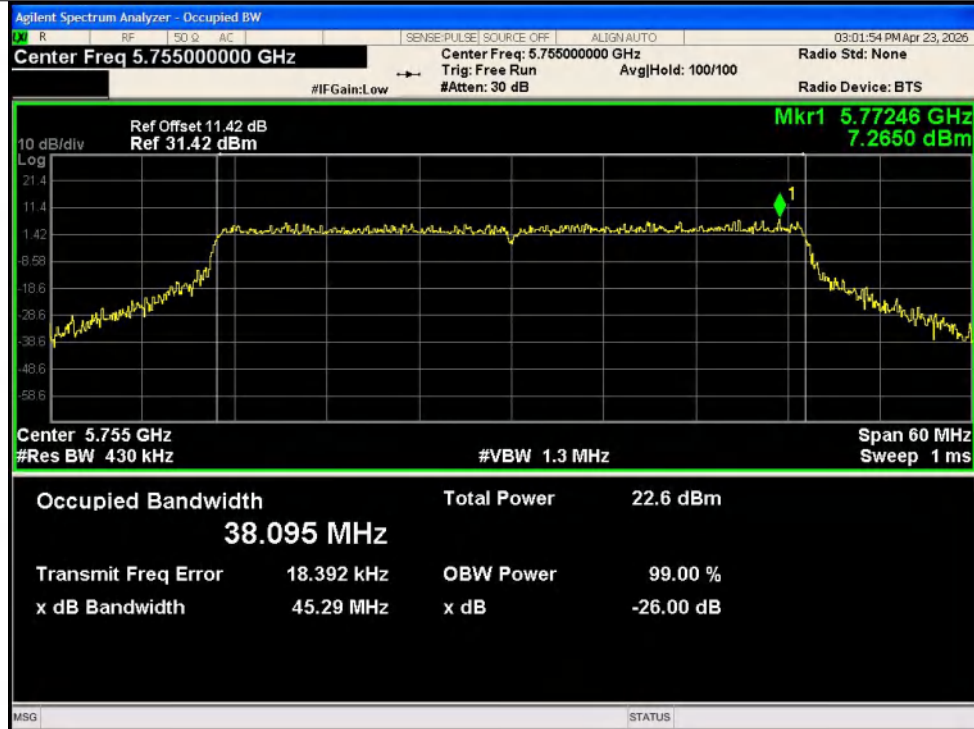

OBW NVNT ax40 5795MHz

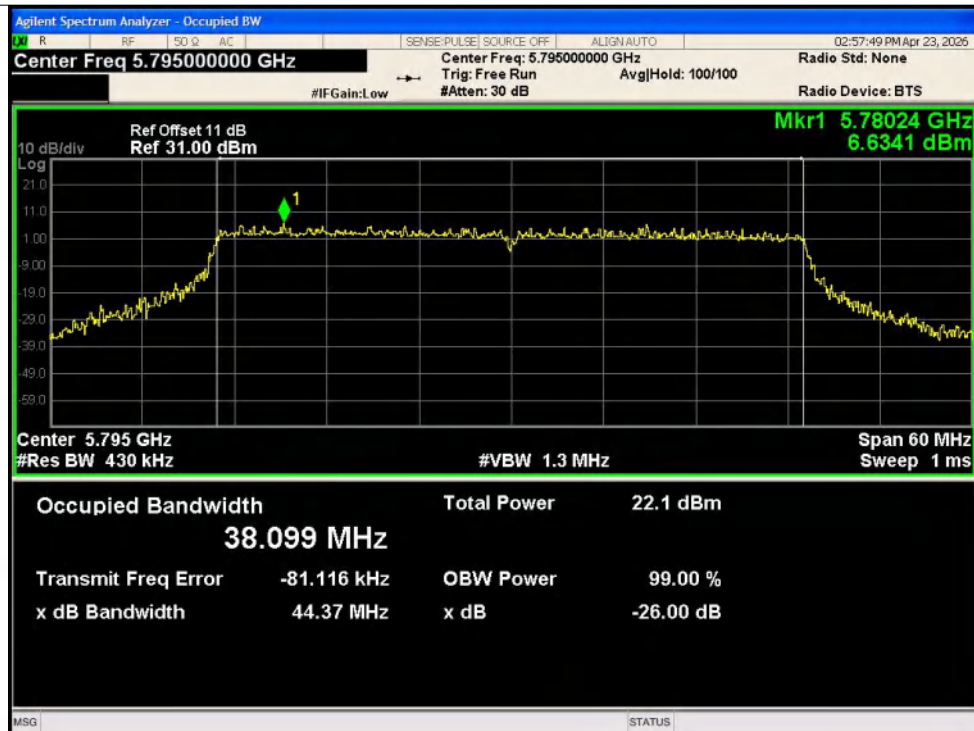


Maximum Power Spectral Density Level


Condition	Mode	Frequency (MHz)	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	1.69	0	1.69	11	Pass
NVNT	a	5200	4.03	0	4.03	11	Pass
NVNT	a	5240	3.85	0	3.85	11	Pass
NVNT	n20	5180	1.31	0	1.31	11	Pass
NVNT	n20	5200	2.64	0	2.64	11	Pass
NVNT	n20	5240	2.64	0	2.64	11	Pass
NVNT	n40	5190	-1.47	0	-1.47	11	Pass
NVNT	n40	5230	-0.21	0	-0.21	11	Pass
NVNT	ac20	5180	0.48	0	0.48	11	Pass
NVNT	ac20	5200	2.69	0	2.69	11	Pass
NVNT	ac20	5240	2.66	0	2.66	11	Pass
NVNT	ac40	5190	-2.41	0	-2.41	11	Pass
NVNT	ac40	5230	-0.31	0	-0.31	11	Pass
NVNT	ax20	5180	0.73	0	0.73	11	Pass
NVNT	ax20	5200	3.09	0	3.09	11	Pass
NVNT	ax20	5240	3.15	0	3.15	11	Pass
NVNT	ax40	5190	-1.74	0	-1.74	11	Pass
NVNT	ax40	5230	0.23	0	0.23	11	Pass

Condition	Mode	Frequency (MHz)	Conducted PSD (dBm/510kHz)	Duty Factor (dB)	Total PSD (dBm/510kHz)	Total PSD (dBm/500kHz)	Limit (dBm/500kHz)	Verdict
NVNT	a	5745	0.18	0	0.18	0.09	30	Pass
NVNT	a	5785	0.33	0	0.33	0.24	30	Pass
NVNT	a	5825	-0.52	0	-0.52	-0.61	30	Pass
NVNT	n20	5745	-0.25	0	-0.25	-0.34	30	Pass
NVNT	n20	5785	-0.83	0	-0.83	-0.92	30	Pass
NVNT	n20	5825	-0.85	0	-0.85	-0.94	30	Pass
NVNT	n40	5755	-2.43	0	-2.43	-2.52	30	Pass
NVNT	n40	5795	-2.18	0	-2.18	-2.27	30	Pass
NVNT	ac20	5745	0.26	0	0.26	0.17	30	Pass
NVNT	ac20	5785	-0.34	0	-0.34	-0.43	30	Pass
NVNT	ac20	5825	-0.32	0	-0.32	-0.41	30	Pass
NVNT	ac40	5755	-1.87	0	-1.87	-1.96	30	Pass
NVNT	ac40	5795	-1.61	0	-1.61	-1.70	30	Pass
NVNT	ax20	5745	0.82	0	0.82	0.73	30	Pass
NVNT	ax20	5785	0.14	0	0.14	0.05	30	Pass
NVNT	ax20	5825	-0.57	0	-0.57	-0.66	30	Pass
NVNT	ax40	5755	-1.61	0	-1.61	-1.70	30	Pass
NVNT	ax40	5795	-1.95	0	-1.95	-2.04	30	Pass


Note: Total PSD (dBm/500kHz) = Total PSD (dBm/510kHz) + 10log(500kHz/510kHz)

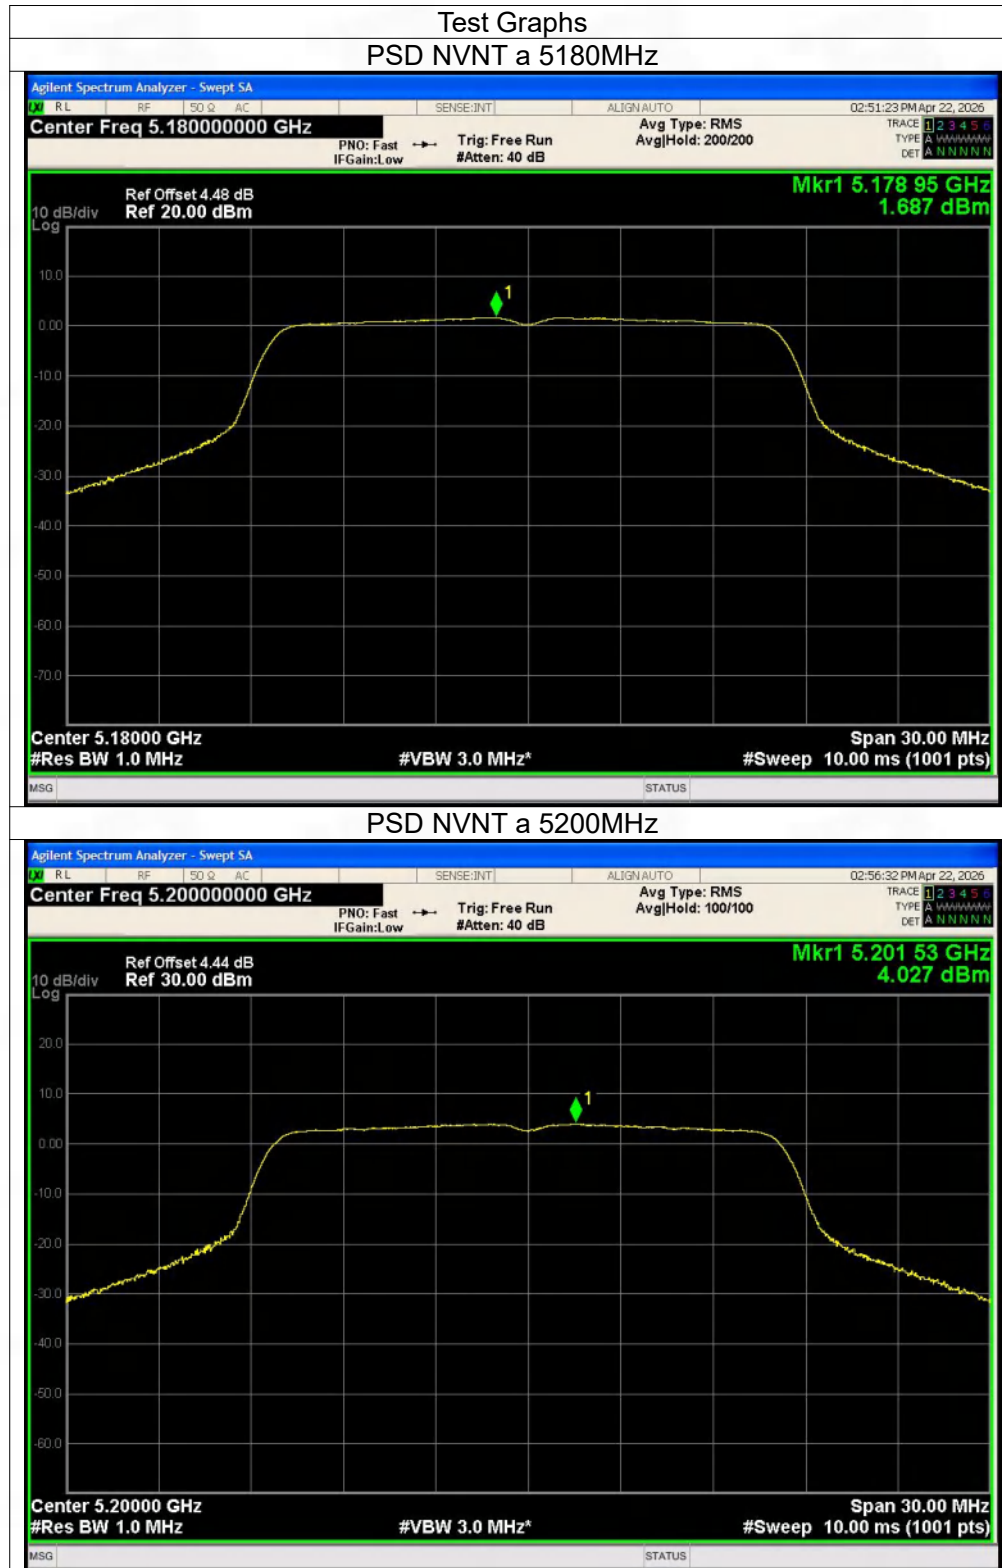


PSD NVNT a 5240MHz

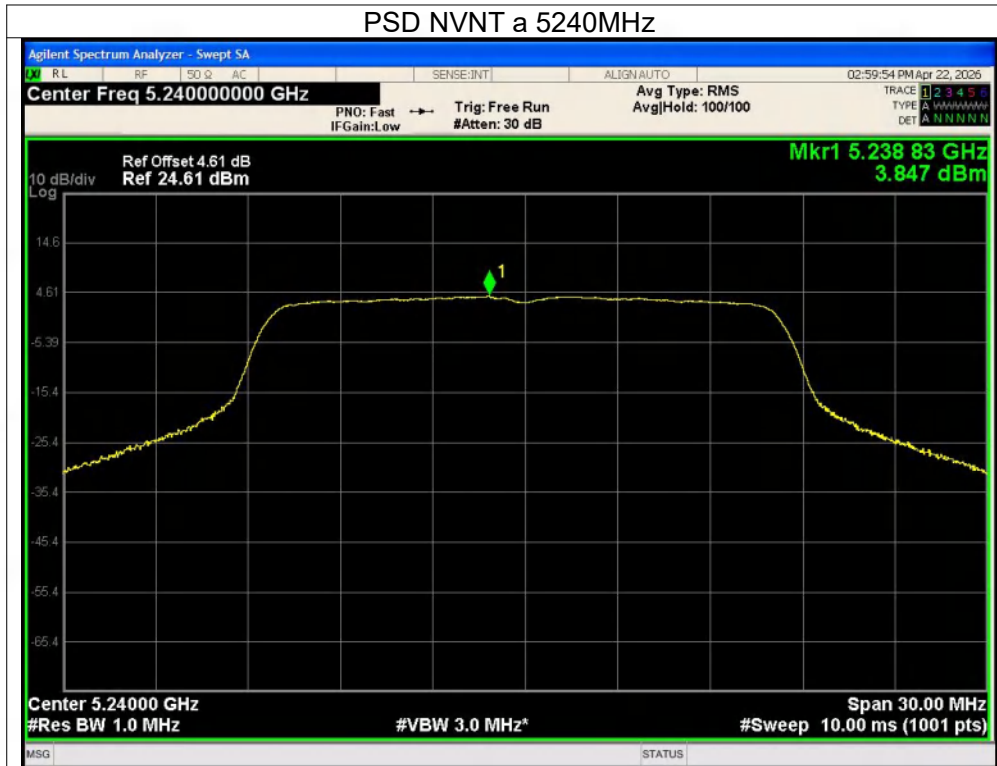


PSD NVNT n20 5180MHz

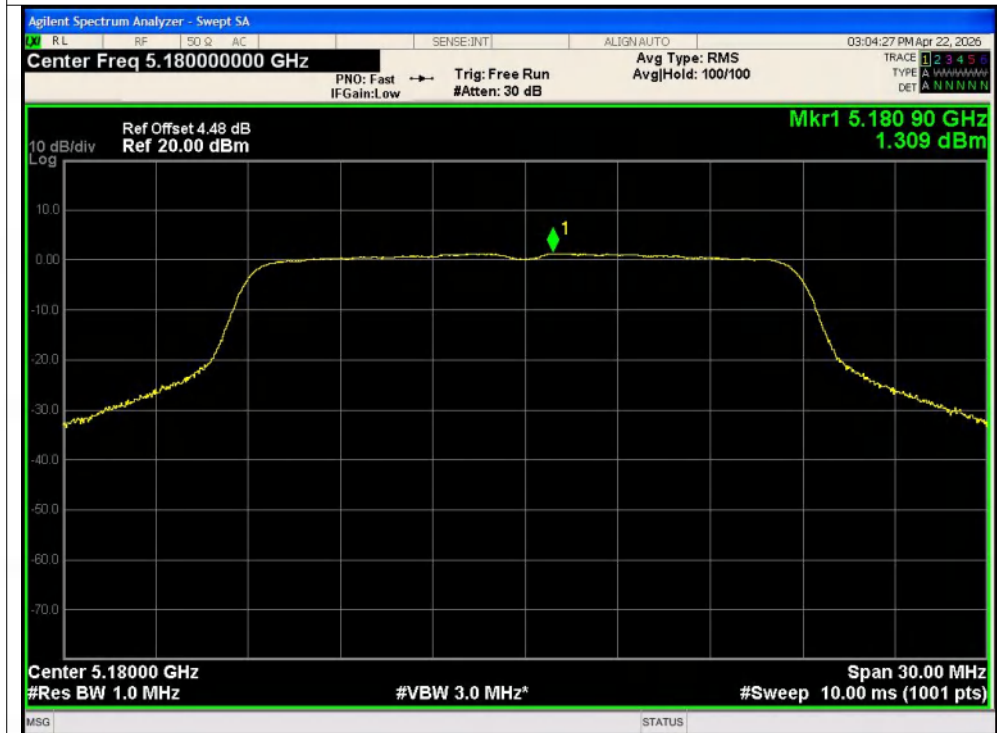


PSD NVNT n20 5200MHz

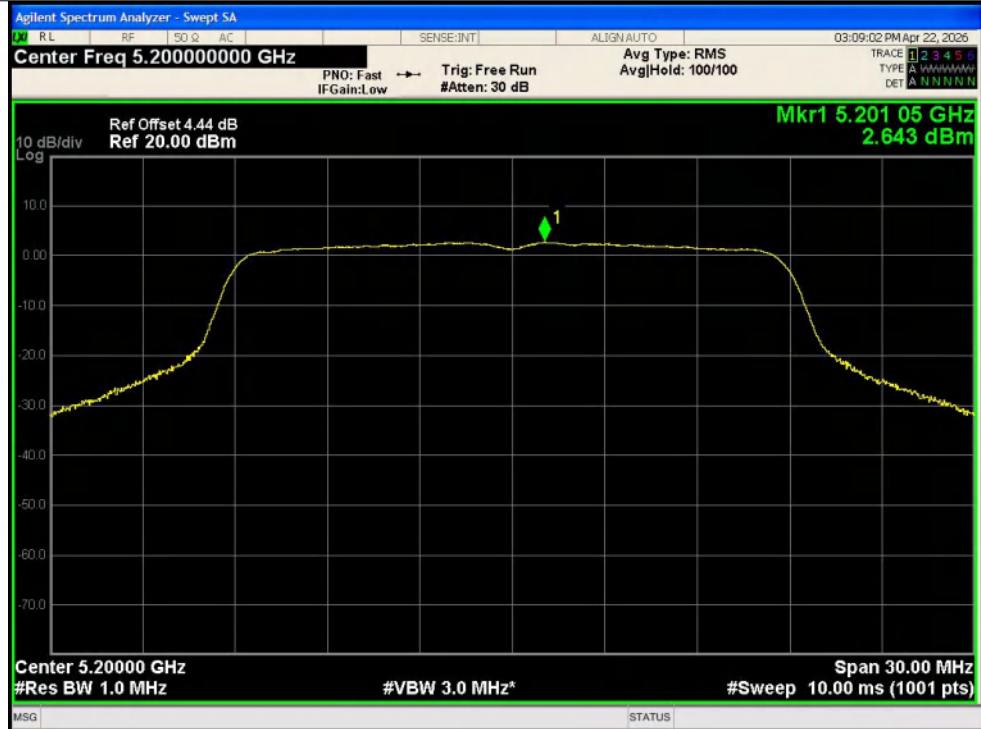

PSD NVNT n20 5240MHz


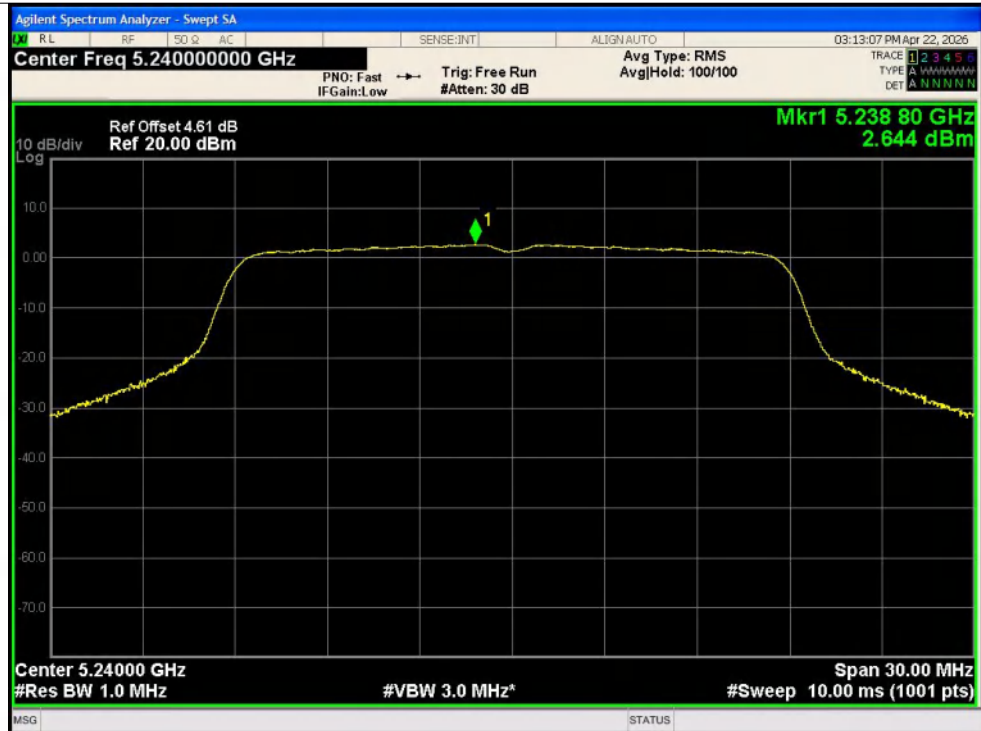




PSD NVNT n40 5190MHz

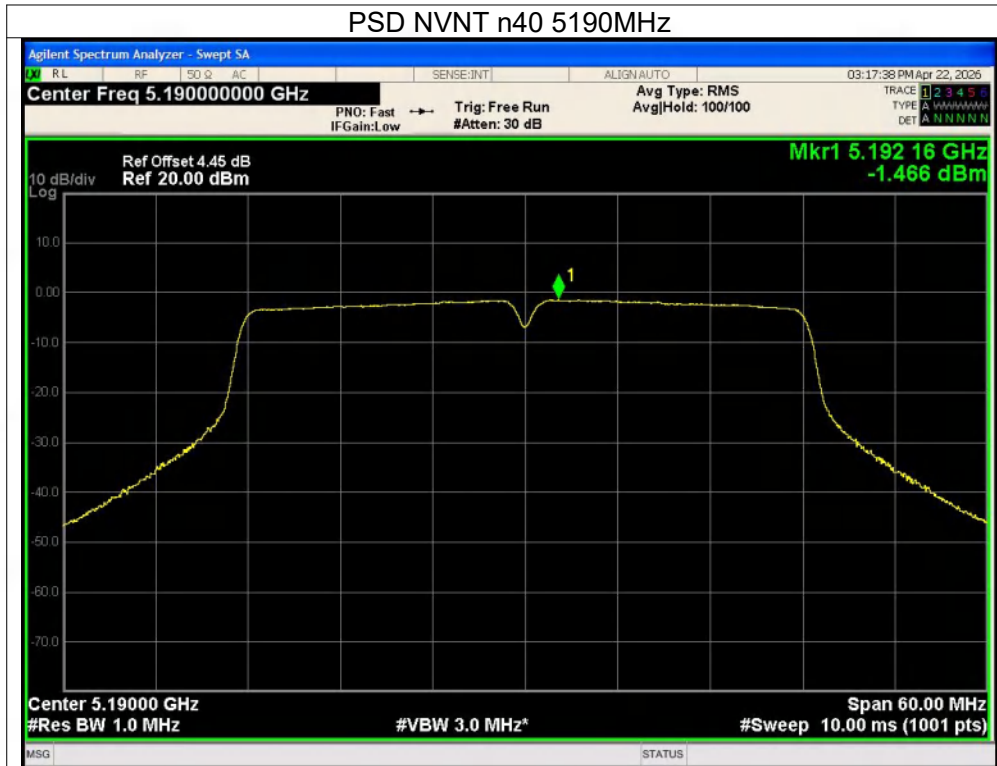




PSD NVNT n40 5230MHz





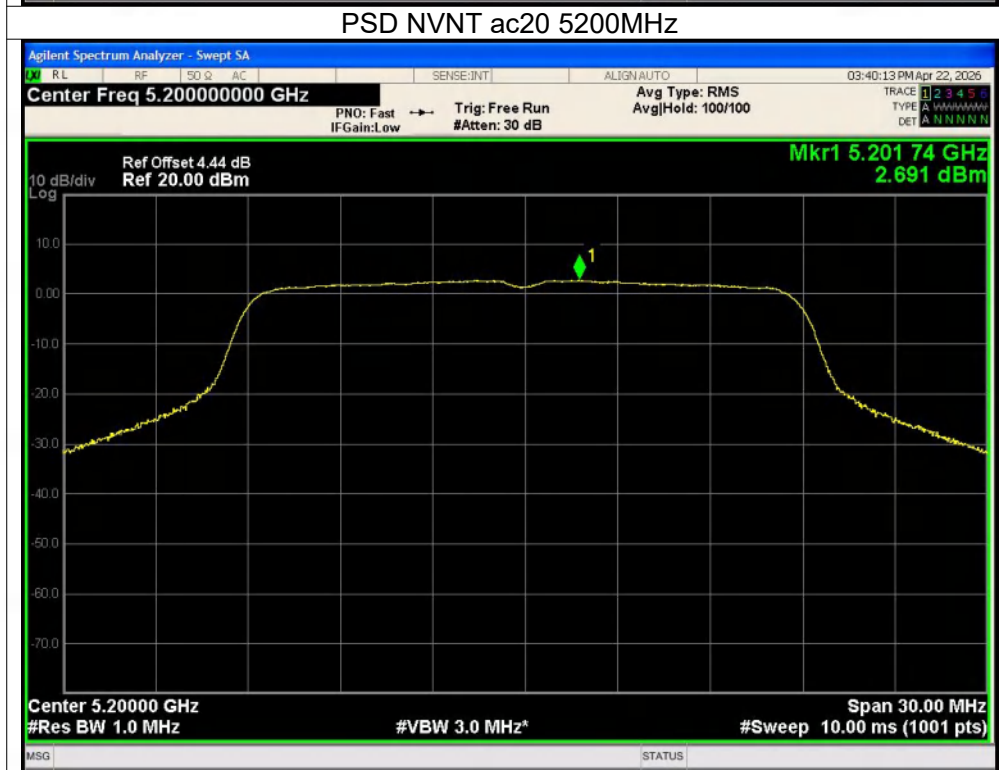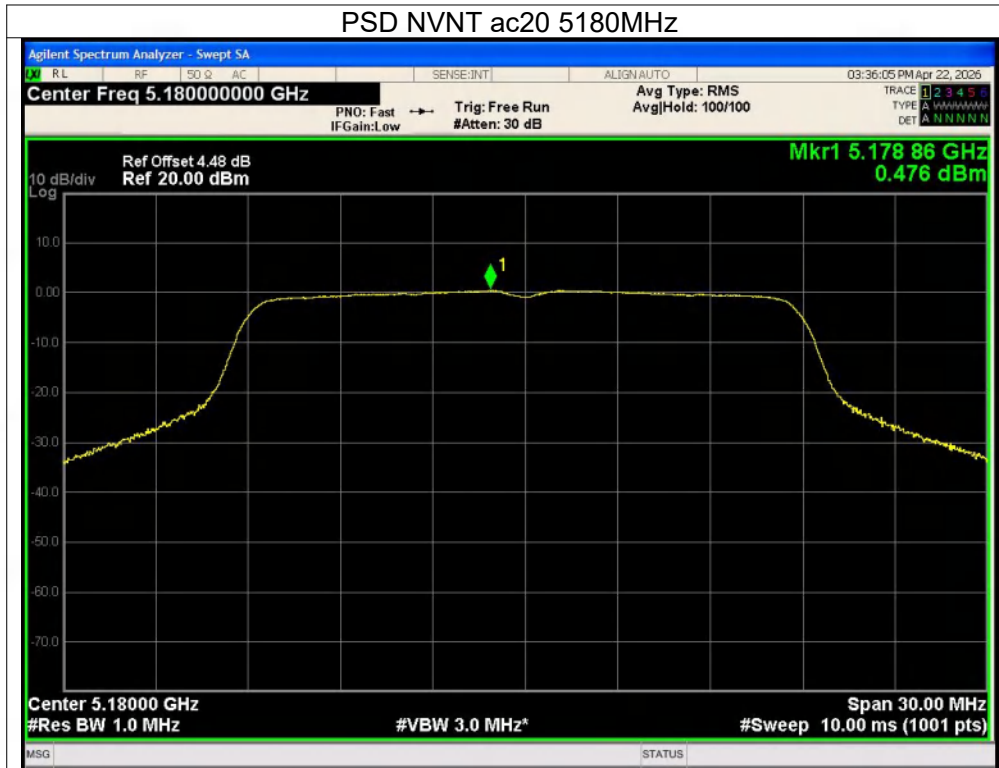

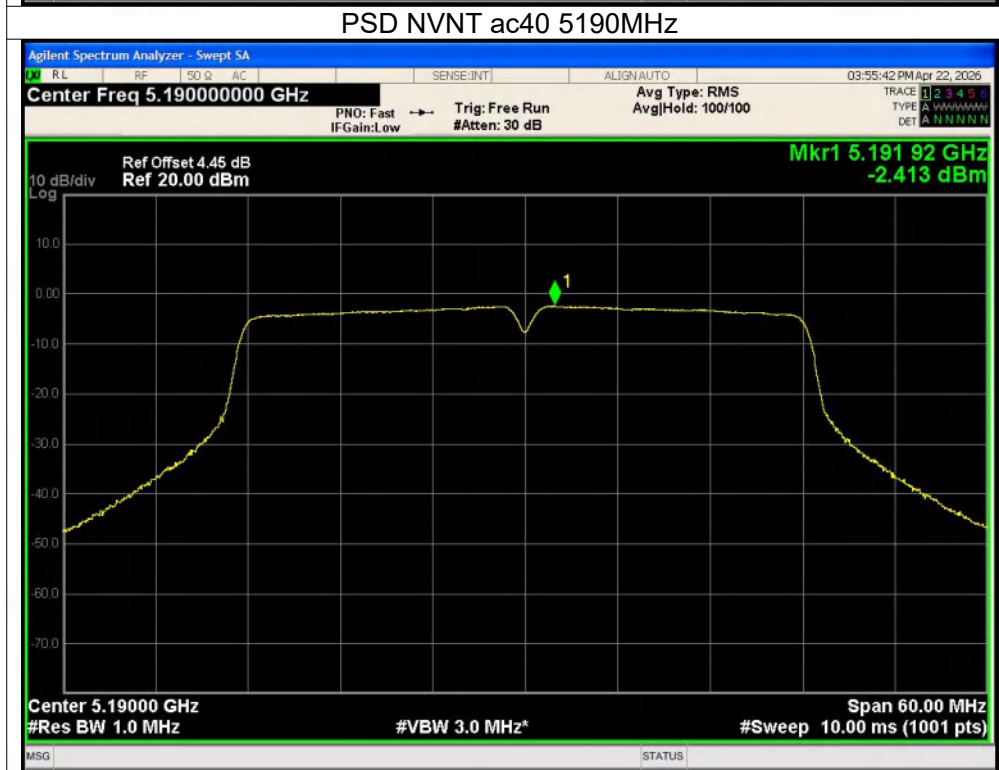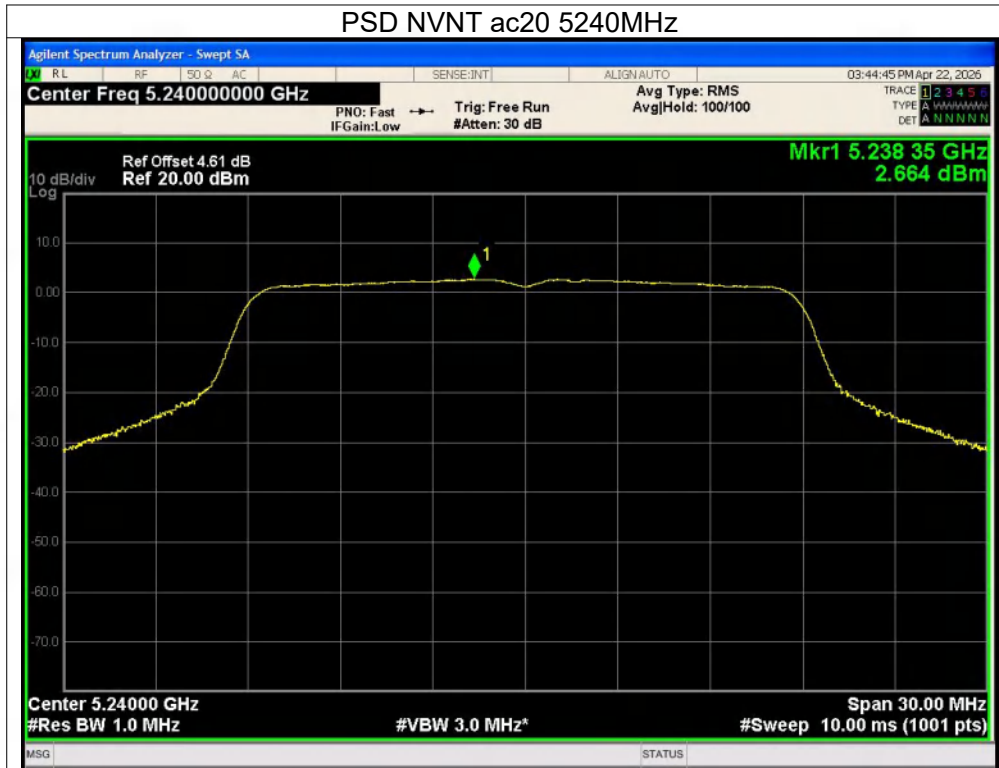

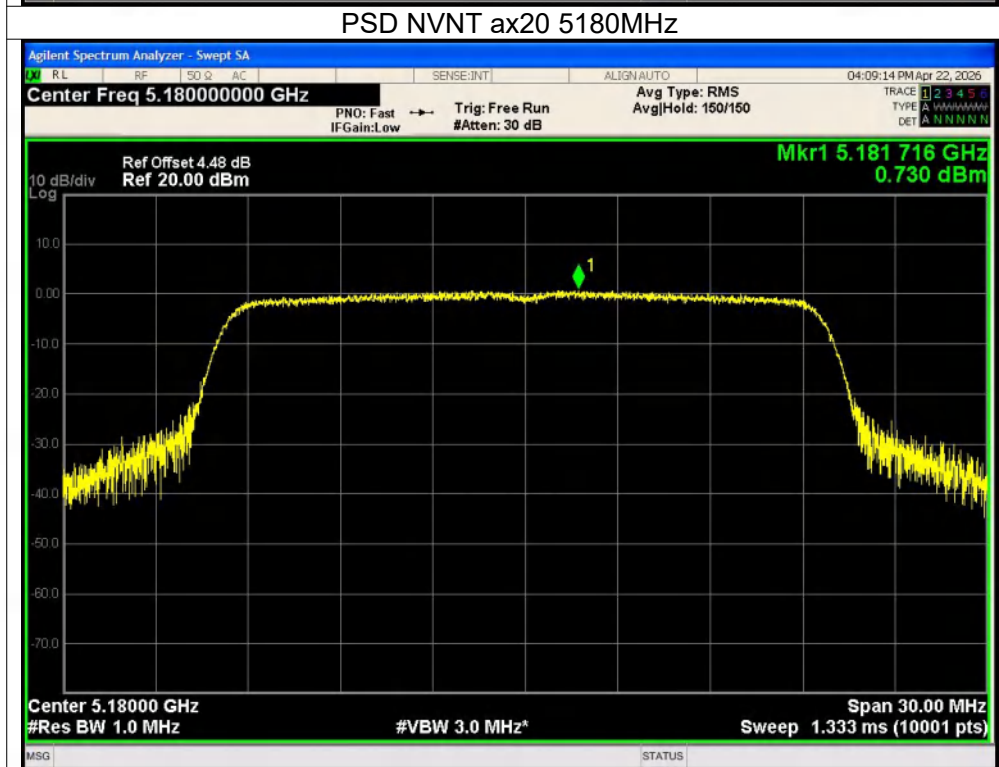


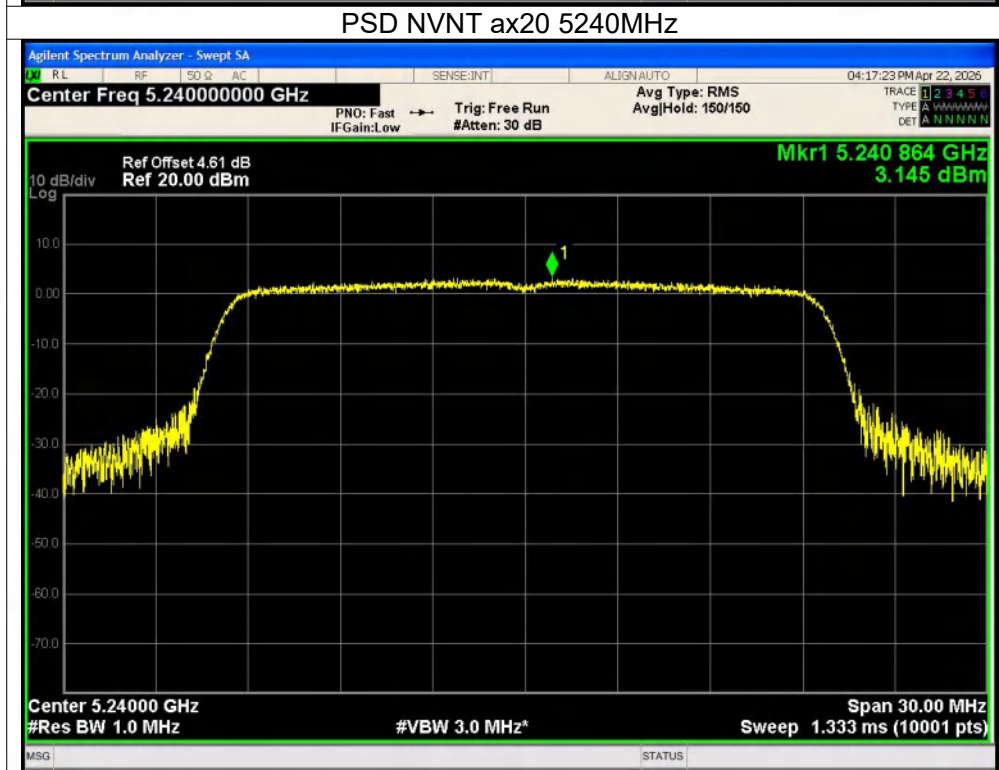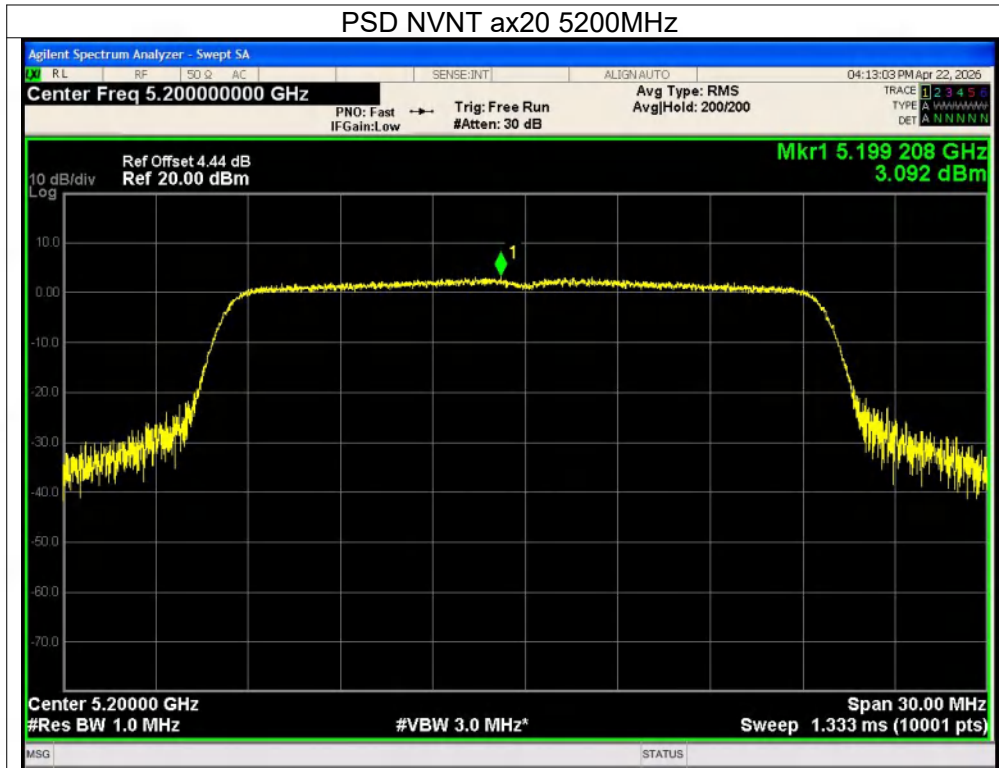

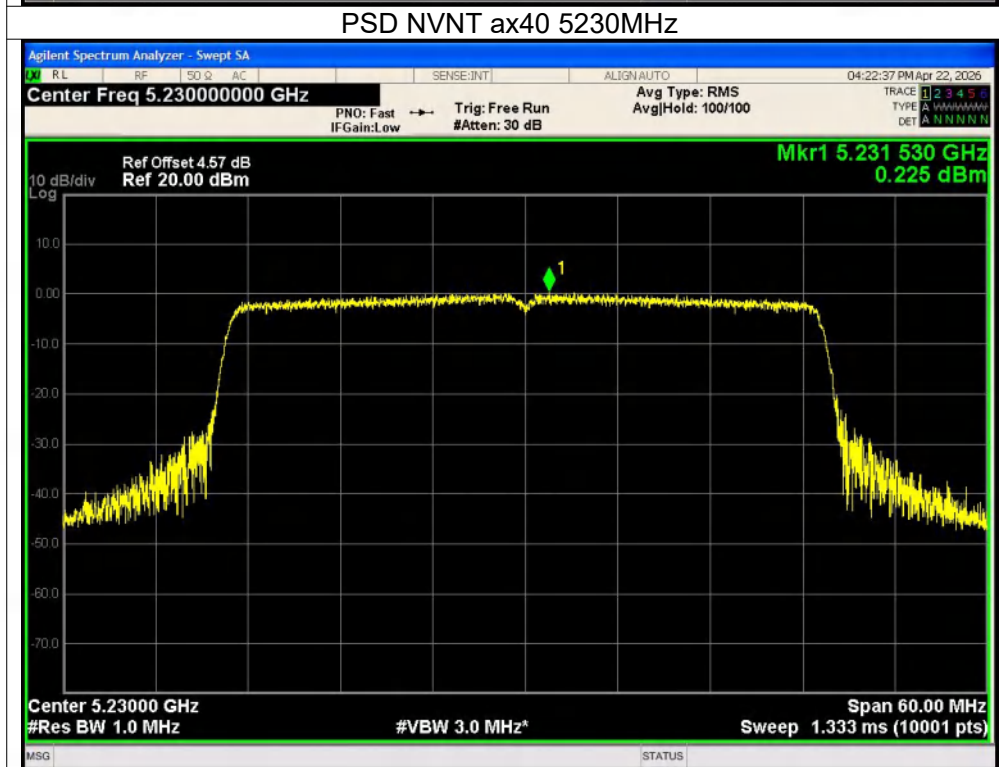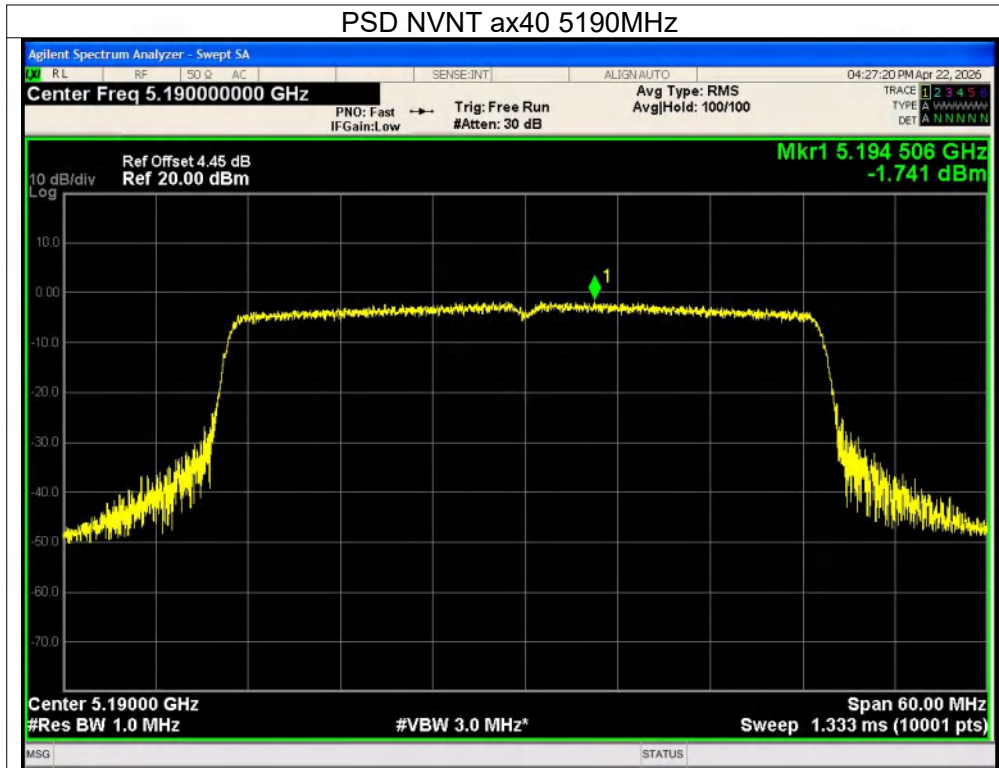


Test Graphs


PSD NVNT a 5745MHz

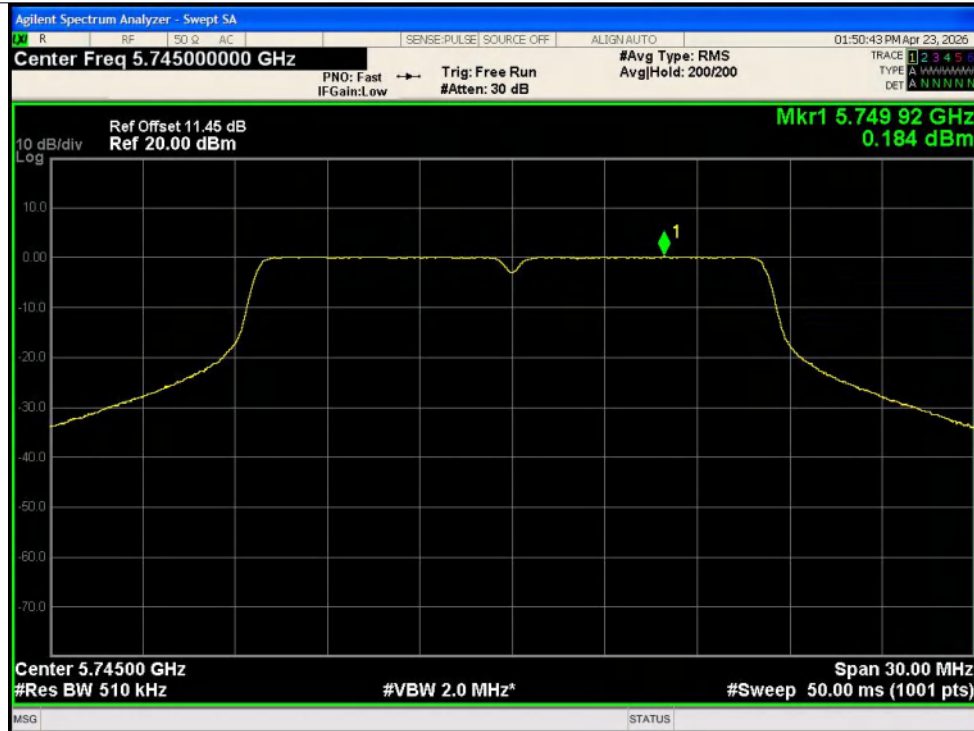


PSD NVNT a 5785MHz

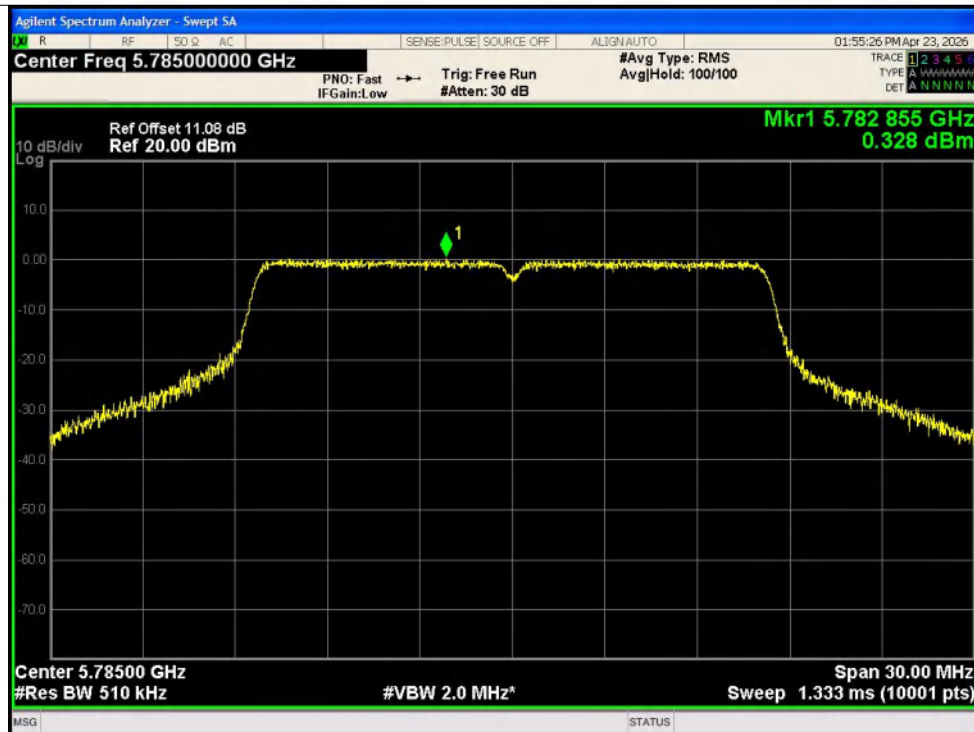


PSD NVNT a 5825MHz

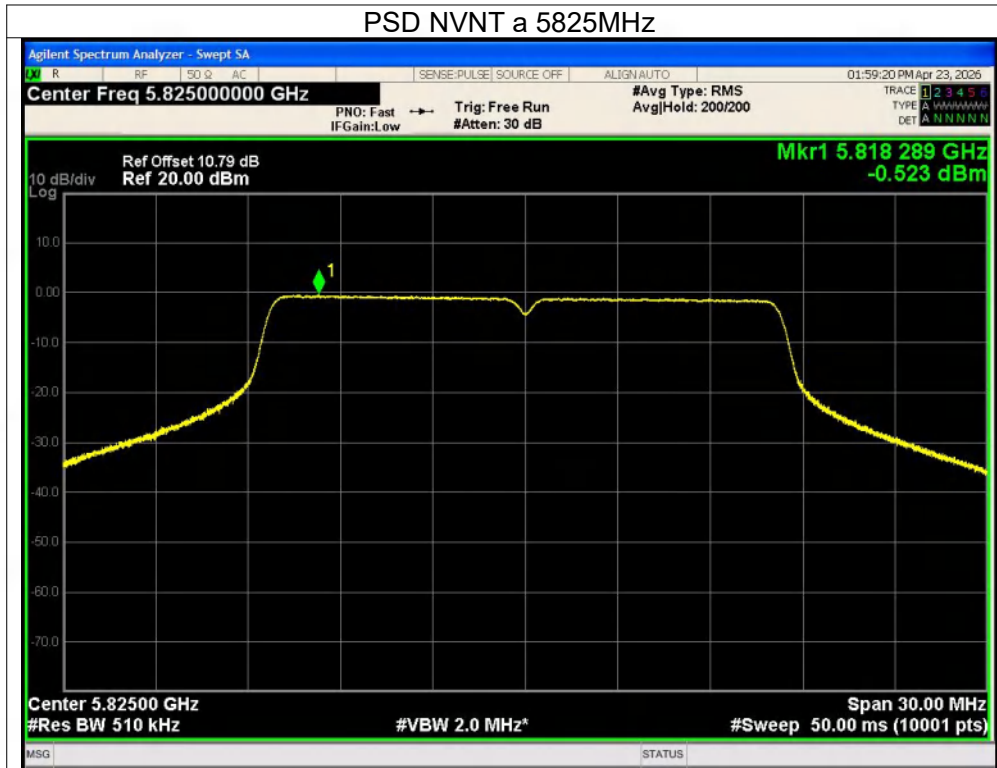


PSD NVNT n20 5745MHz

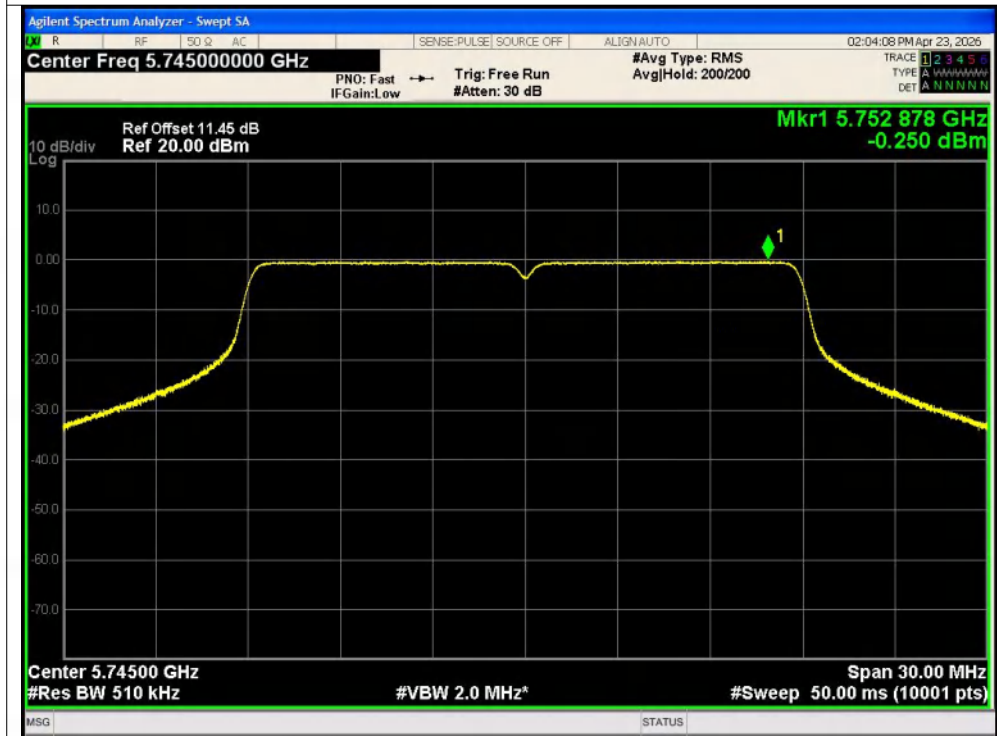


PSD NVNT n20 5785MHz

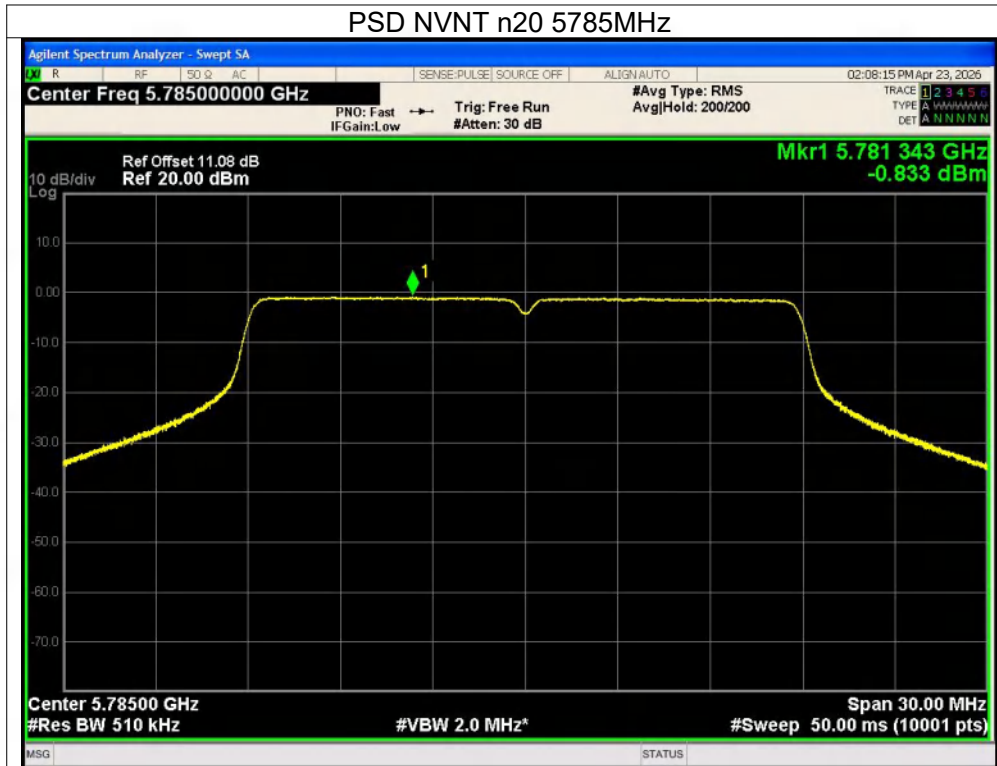


PSD NVNT n20 5825MHz

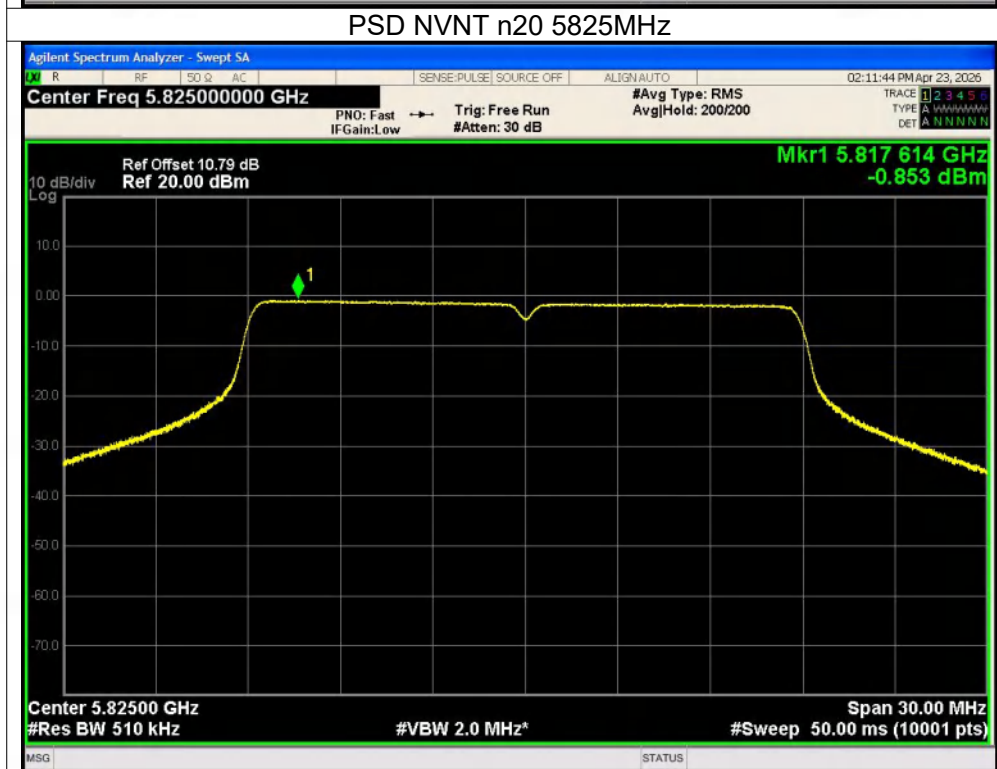


PSD NVNT n40 5755MHz

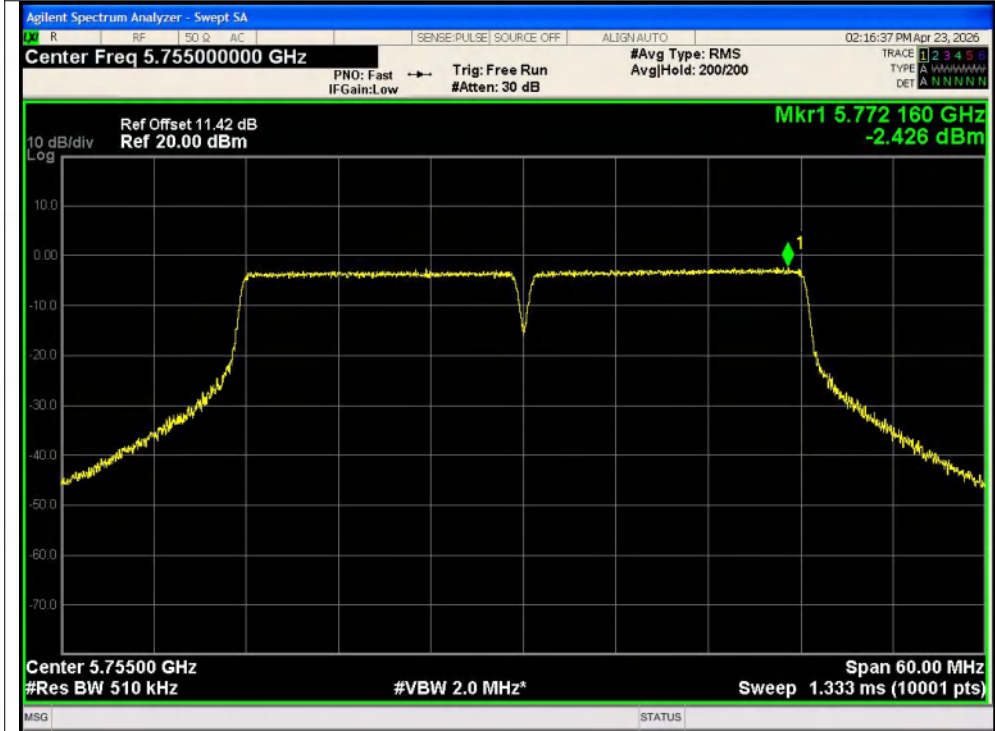


PSD NVNT n40 5795MHz

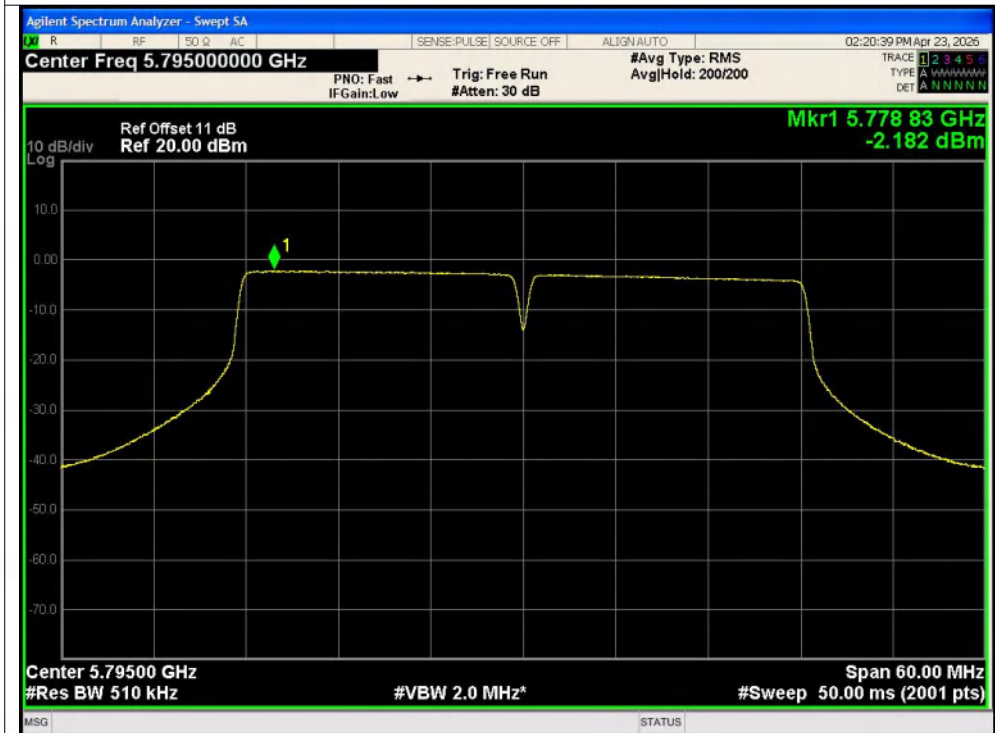


PSD NVNT ac20 5745MHz

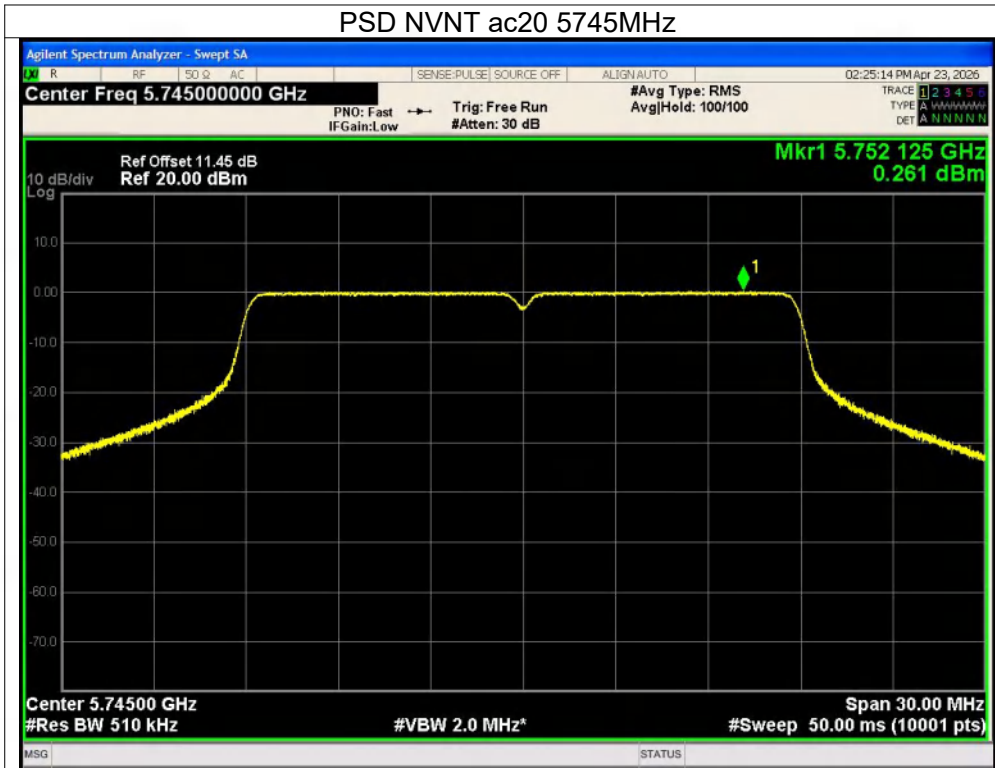


PSD NVNT ac20 5785MHz


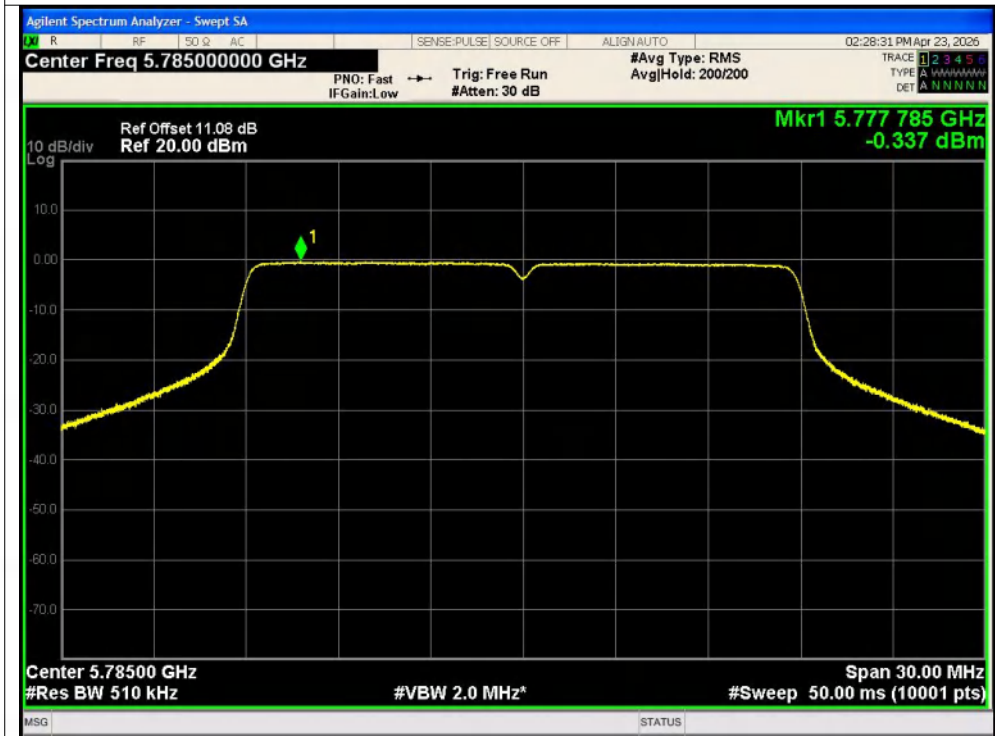



PSD NVNT ac20 5825MHz


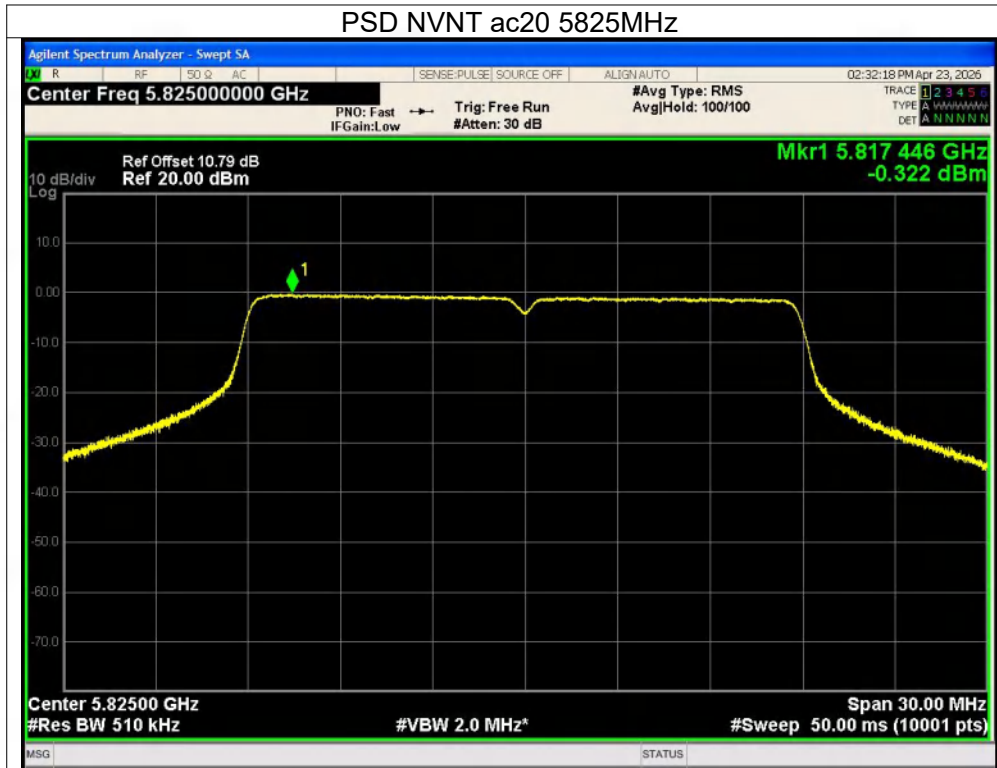


PSD NVNT ac40 5755MHz

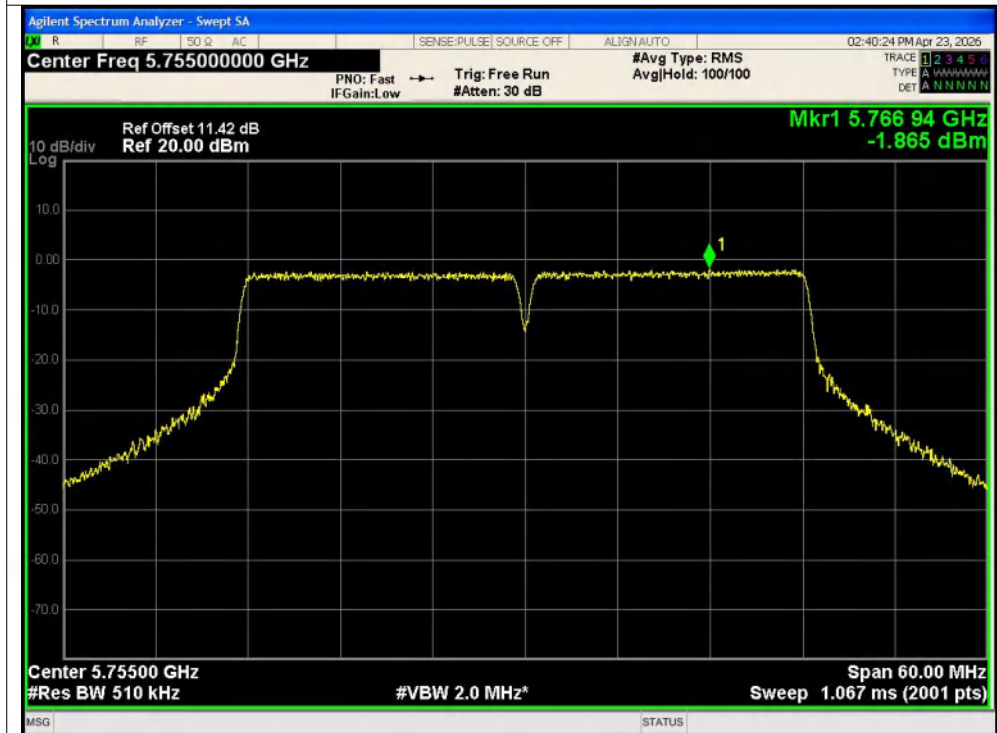

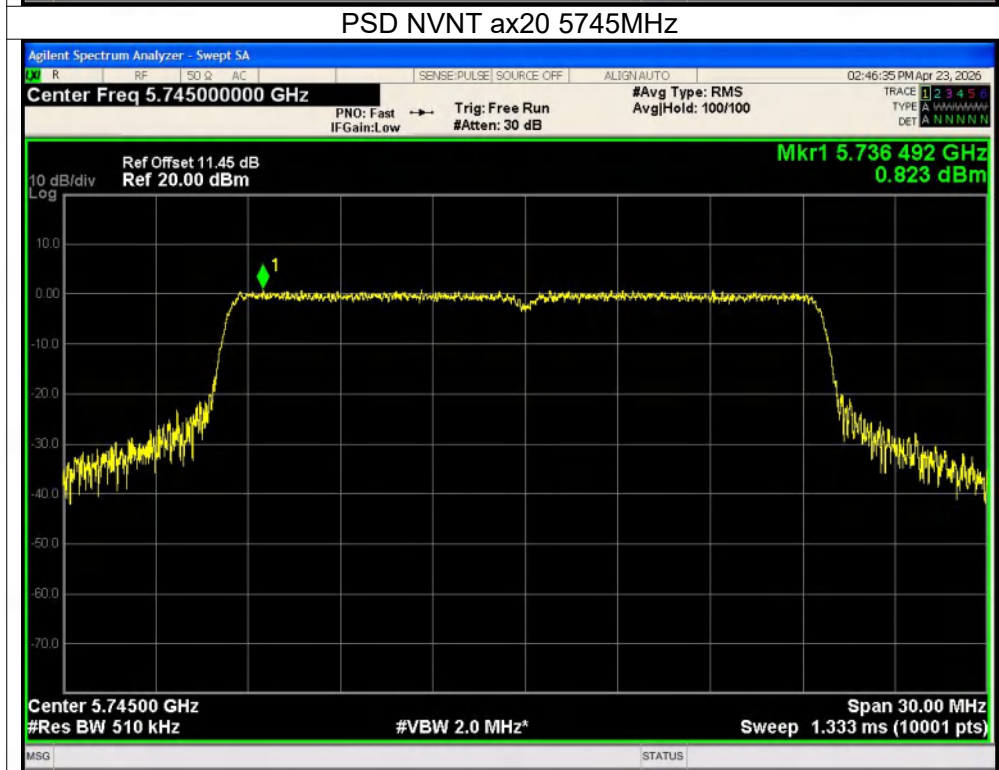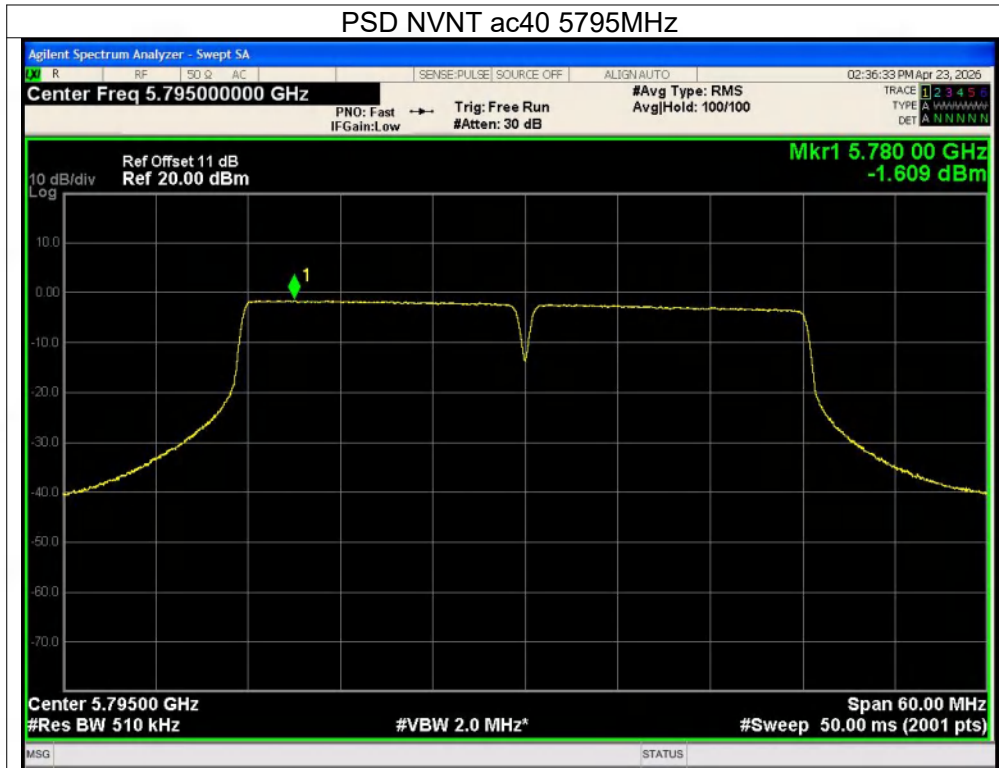

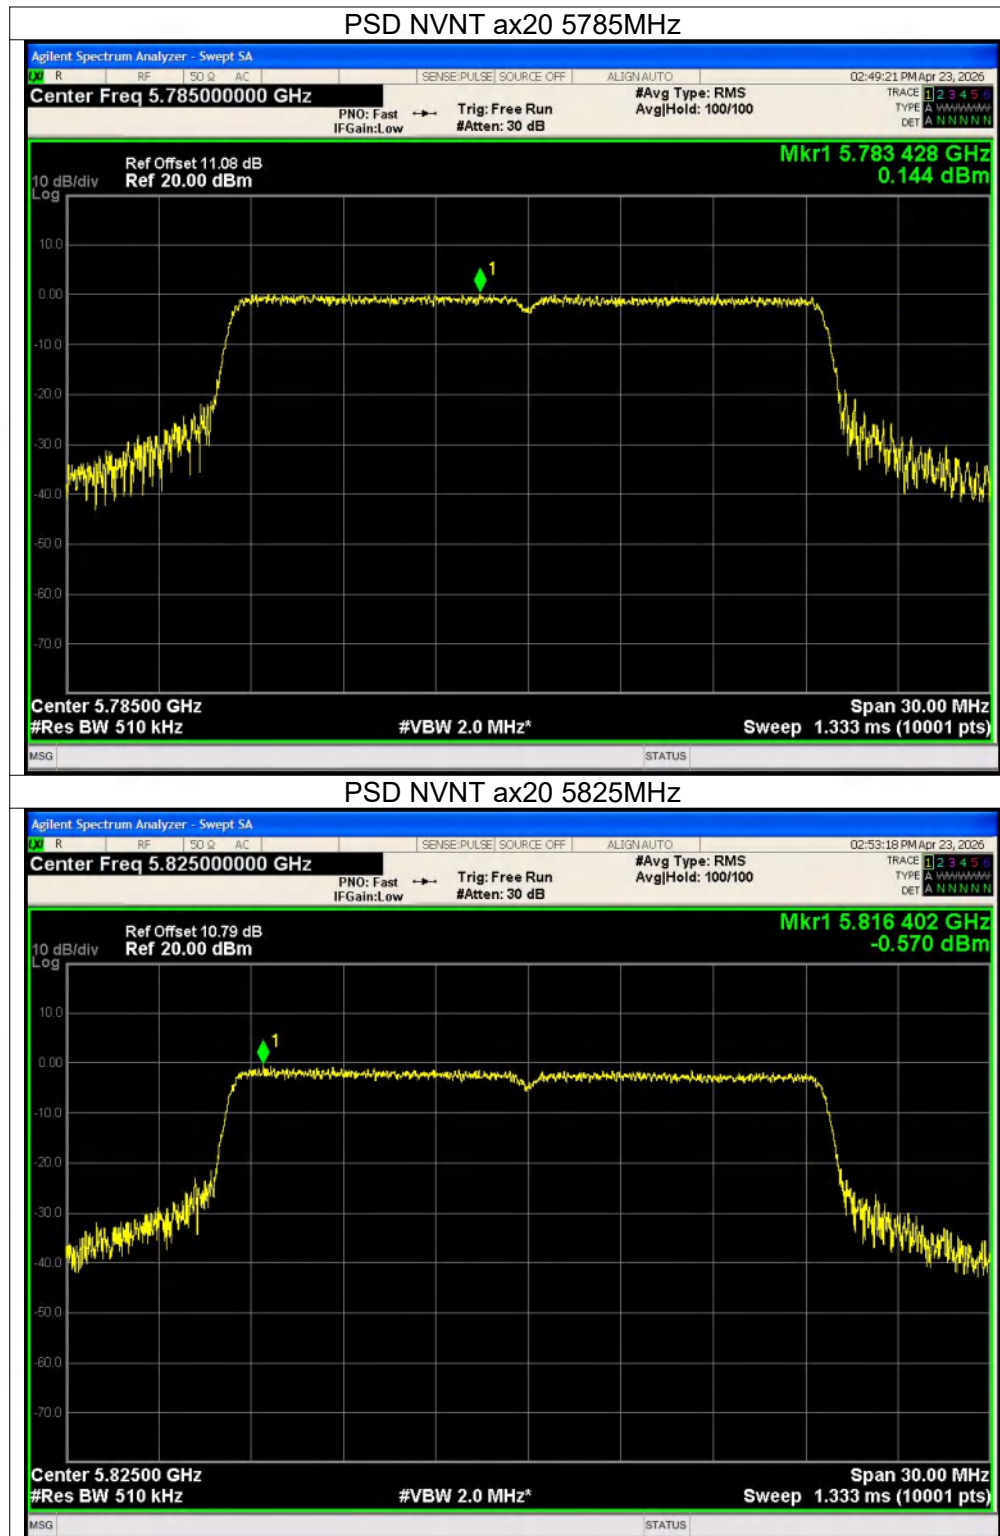

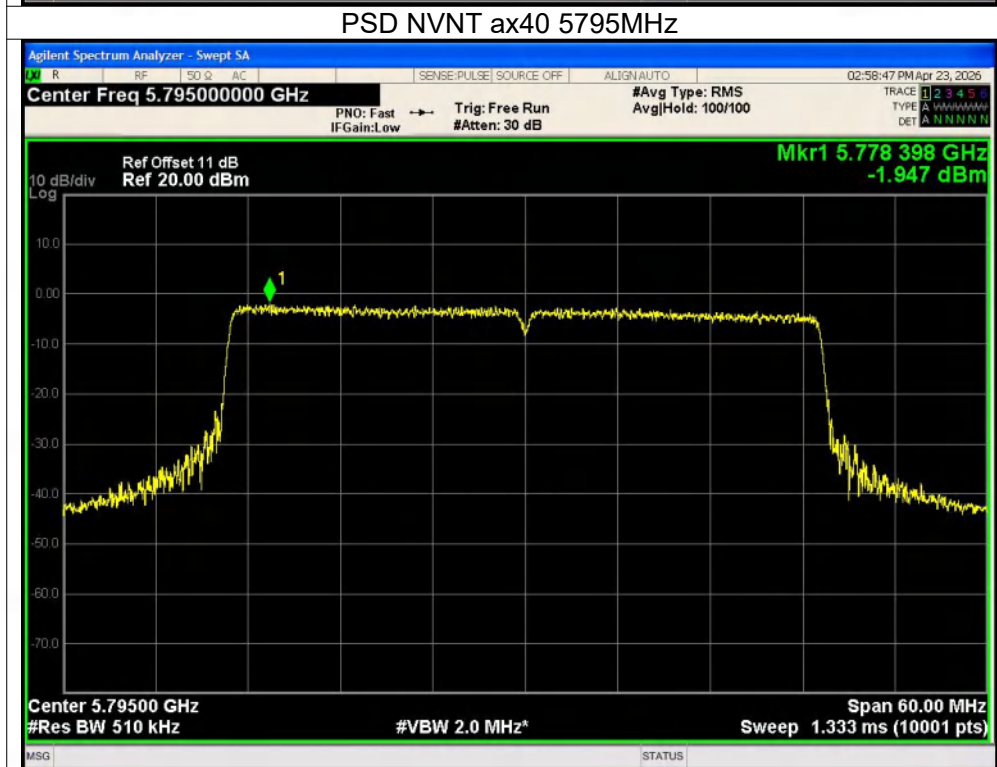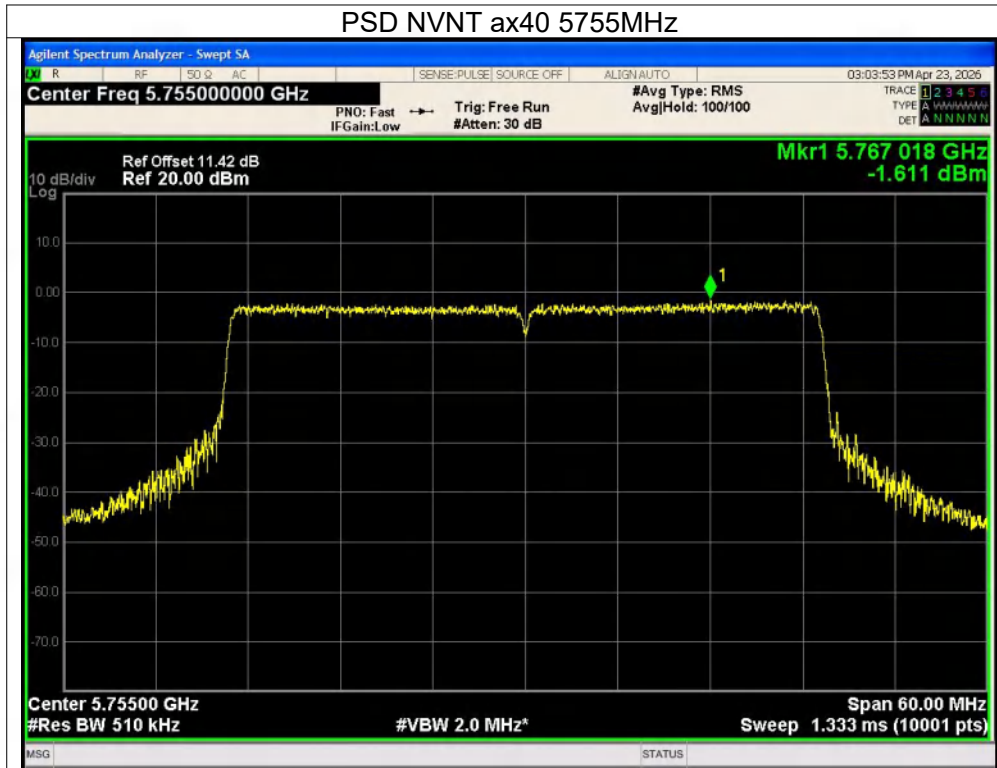

Frequency Stability

Condition	Mode	Frequency (MHz)	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	a	5180	5179.94	-60000	-11.58	25	Pass
20C 120V	a	5180	5179.96	-40000	-7.72	25	Pass
20C 138V	a	5180	5179.94	-60000	-11.58	25	Pass
-20C 120V	a	5180	5179.96	-40000	-7.72	25	Pass
-10C 120V	a	5180	5179.96	-40000	-7.72	25	Pass
0C 120V	a	5180	5179.98	-20000	-3.86	25	Pass
10C 120V	a	5180	5179.94	-60000	-11.58	25	Pass
30C 120V	a	5180	5179.98	-20000	-3.86	25	Pass
40C 120V	a	5180	5179.98	-20000	-3.86	25	Pass
50C 120V	a	5180	5179.98	-20000	-3.86	25	Pass
20C 102V	a	5200	5199.96	-40000	-7.69	25	Pass
20C 120V	a	5200	5199.98	-20000	-3.85	25	Pass
20C 138V	a	5200	5199.98	-20000	-3.85	25	Pass
-20C 120V	a	5200	5199.98	-20000	-3.85	25	Pass
-10C 120V	a	5200	5199.98	-20000	-3.85	25	Pass
0C 120V	a	5200	5199.98	-20000	-3.85	25	Pass
10C 120V	a	5200	5199.98	-20000	-3.85	25	Pass
30C 120V	a	5200	5199.98	-20000	-3.85	25	Pass
40C 120V	a	5200	5199.96	-40000	-7.69	25	Pass
50C 120V	a	5200	5199.98	-20000	-3.85	25	Pass
20C 102V	a	5240	5239.98	-20000	-3.82	25	Pass
20C 120V	a	5240	5239.98	-20000	-3.82	25	Pass
20C 138V	a	5240	5239.98	-20000	-3.82	25	Pass
-20C 120V	a	5240	5239.98	-20000	-3.82	25	Pass
-10C 120V	a	5240	5239.98	-20000	-3.82	25	Pass
0C 120V	a	5240	5239.98	-20000	-3.82	25	Pass
10C 120V	a	5240	5239.98	-20000	-3.82	25	Pass
20C 120V	a	5240	5239.96	-40000	-7.63	25	Pass
30C 120V	a	5240	5239.98	-20000	-3.82	25	Pass
40C 120V	a	5240	5239.98	-20000	-3.82	25	Pass
50C 120V	a	5240	5239.98	-20000	-3.82	25	Pass
20C 102V	n20	5180	5179.98	-20000	-3.86	25	Pass
20C 120V	n20	5180	5179.98	-20000	-3.86	25	Pass
20C 138V	n20	5180	5179.98	-20000	-3.86	25	Pass
-20C 120V	n20	5180	5179.98	-20000	-3.86	25	Pass
-10C 120V	n20	5180	5179.98	-20000	-3.86	25	Pass
0C 120V	n20	5180	5180	0	0	25	Pass
10C 120V	n20	5180	5179.96	-40000	-7.72	25	Pass
30C 120V	n20	5180	5179.98	-20000	-3.86	25	Pass
40C 120V	n20	5180	5179.96	-40000	-7.72	25	Pass
50C 120V	n20	5180	5179.98	-20000	-3.86	25	Pass
20C 102V	n20	5200	5199.98	-20000	-3.85	25	Pass
20C 120V	n20	5200	5199.98	-20000	-3.85	25	Pass
20C 138V	n20	5200	5199.98	-20000	-3.85	25	Pass
-20C 120V	n20	5200	5199.98	-20000	-3.85	25	Pass
-10C 120V	n20	5200	5200	0	0	25	Pass
0C 120V	n20	5200	5200	0	0	25	Pass
10C 120V	n20	5200	5199.98	-20000	-3.85	25	Pass
30C 120V	n20	5200	5200	0	0	25	Pass
40C 120V	n20	5200	5199.98	-20000	-3.85	25	Pass

Total or partial reproduction of this document without permission of the Laboratory is not allowed.

Page 138 of

326

BTF Testing Lab (Shenzhen) Co., Ltd.

Plant 101, 201 and 301, Building 1, Block 2, Tantou Industrial Park, Tantou Community, Songgang Street, Bao'an District, Shenzhen, Guangdong, China

Email: info@btf-lab.com

Tel: +86-755-23146130

<http://www.btf-lab.com> Version: 1/00

50C 120V	n20	5200	5199.98	-20000	-3.85	25	Pass
20C 102V	n20	5240	5239.98	-20000	-3.82	25	Pass
20C 120V	n20	5240	5239.98	-20000	-3.82	25	Pass
20C 138V	n20	5240	5240	0	0	25	Pass
-20C 120V	n20	5240	5239.98	-20000	-3.82	25	Pass
-10C 120V	n20	5240	5239.98	-20000	-3.82	25	Pass
0C 120V	n20	5240	5240	0	0	25	Pass
10C 120V	n20	5240	5239.98	-20000	-3.82	25	Pass
20C 120V	n20	5240	5239.98	-20000	-3.82	25	Pass
30C 120V	n20	5240	5239.96	-40000	-7.63	25	Pass
40C 120V	n20	5240	5239.98	-20000	-3.82	25	Pass
50C 120V	n20	5240	5239.98	-20000	-3.82	25	Pass
20C 102V	n40	5190	5190	0	0	25	Pass
20C 120V	n40	5190	5190	0	0	25	Pass
20C 138V	n40	5190	5190	0	0	25	Pass
-20C 120V	n40	5190	5190	0	0	25	Pass
-10C 120V	n40	5190	5190	0	0	25	Pass
0C 120V	n40	5190	5190	0	0	25	Pass
10C 120V	n40	5190	5190	0	0	25	Pass
30C 120V	n40	5190	5190	0	0	25	Pass
40C 120V	n40	5190	5190	0	0	25	Pass
50C 120V	n40	5190	5190	0	0	25	Pass
20C 102V	n40	5230	5230	0	0	25	Pass
20C 120V	n40	5230	5230	0	0	25	Pass
20C 138V	n40	5230	5230	0	0	25	Pass
-20C 120V	n40	5230	5230	0	0	25	Pass
-10C 120V	n40	5230	5230	0	0	25	Pass
0C 120V	n40	5230	5230	0	0	25	Pass
10C 120V	n40	5230	5230	0	0	25	Pass
30C 120V	n40	5230	5230	0	0	25	Pass
40C 120V	n40	5230	5229.96	-40000	-7.65	25	Pass
50C 120V	n40	5230	5230	0	0	25	Pass
20C 102V	ac20	5180	5180	0	0	25	Pass
20C 120V	ac20	5180	5179.98	-20000	-3.86	25	Pass
20C 138V	ac20	5180	5179.96	-40000	-7.72	25	Pass
-20C 120V	ac20	5180	5180	0	0	25	Pass
-10C 120V	ac20	5180	5179.98	-20000	-3.86	25	Pass
0C 120V	ac20	5180	5179.98	-20000	-3.86	25	Pass
10C 120V	ac20	5180	5179.98	-20000	-3.86	25	Pass
30C 120V	ac20	5180	5179.98	-20000	-3.86	25	Pass
40C 120V	ac20	5180	5179.98	-20000	-3.86	25	Pass
50C 120V	ac20	5180	5179.98	-20000	-3.86	25	Pass
20C 102V	ac20	5200	5200	0	0	25	Pass
20C 120V	ac20	5200	5199.98	-20000	-3.85	25	Pass
20C 138V	ac20	5200	5199.98	-20000	-3.85	25	Pass
-20C 120V	ac20	5200	5199.98	-20000	-3.85	25	Pass
-10C 120V	ac20	5200	5199.96	-40000	-7.69	25	Pass
0C 120V	ac20	5200	5199.98	-20000	-3.85	25	Pass
10C 120V	ac20	5200	5199.98	-20000	-3.85	25	Pass
30C 120V	ac20	5200	5199.98	-20000	-3.85	25	Pass
40C 120V	ac20	5200	5200	0	0	25	Pass
50C 120V	ac20	5200	5199.98	-20000	-3.85	25	Pass
20C 102V	ac20	5240	5239.98	-20000	-3.82	25	Pass
20C 120V	ac20	5240	5239.98	-20000	-3.82	25	Pass
20C 138V	ac20	5240	5239.96	-40000	-7.63	25	Pass

-20C 120V	ac20	5240	5239.98	-20000	-3.82	25	Pass
-10C 120V	ac20	5240	5239.98	-20000	-3.82	25	Pass
0C 120V	ac20	5240	5240	0	0	25	Pass
10C 120V	ac20	5240	5239.96	-40000	-7.63	25	Pass
30C 120V	ac20	5240	5239.98	-20000	-3.82	25	Pass
40C 120V	ac20	5240	5240	0	0	25	Pass
50C 120V	ac20	5240	5239.98	-20000	-3.82	25	Pass
20C 102V	ac40	5190	5190	0	0	25	Pass
20C 120V	ac40	5190	5190	0	0	25	Pass
20C 138V	ac40	5190	5190	0	0	25	Pass
-20C 120V	ac40	5190	5190	0	0	25	Pass
-10C 120V	ac40	5190	5189.96	-40000	-7.71	25	Pass
0C 120V	ac40	5190	5189.96	-40000	-7.71	25	Pass
10C 120V	ac40	5190	5190	0	0	25	Pass
30C 120V	ac40	5190	5190	0	0	25	Pass
40C 120V	ac40	5190	5190	0	0	25	Pass
50C 120V	ac40	5190	5190	0	0	25	Pass
20C 102V	ac40	5230	5230	0	0	25	Pass
20C 120V	ac40	5230	5230	0	0	25	Pass
20C 138V	ac40	5230	5229.96	-40000	-7.65	25	Pass
-20C 120V	ac40	5230	5230	0	0	25	Pass
-10C 120V	ac40	5230	5230	0	0	25	Pass
0C 120V	ac40	5230	5230	0	0	25	Pass
10C 120V	ac40	5230	5230	0	0	25	Pass
30C 120V	ac40	5230	5230	0	0	25	Pass
40C 120V	ac40	5230	5230	0	0	25	Pass
50C 120V	ac40	5230	5230	0	0	25	Pass
20C 102V	ax20	5180	5179.98	-20000	-3.86	25	Pass
20C 120V	ax20	5180	5180	0	0	25	Pass
20C 138V	ax20	5180	5179.98	-20000	-3.86	25	Pass
-20C 120V	ax20	5180	5179.98	-20000	-3.86	25	Pass
-10C 120V	ax20	5180	5180	0	0	25	Pass
0C 120V	ax20	5180	5179.98	-20000	-3.86	25	Pass
10C 120V	ax20	5180	5179.98	-20000	-3.86	25	Pass
30C 120V	ax20	5180	5180	0	0	25	Pass
40C 120V	ax20	5180	5179.98	-20000	-3.86	25	Pass
50C 120V	ax20	5180	5179.98	-20000	-3.86	25	Pass
20C 102V	ax20	5200	5199.98	-20000	-3.85	25	Pass
20C 120V	ax20	5200	5200	0	0	25	Pass
20C 138V	ax20	5200	5199.98	-20000	-3.85	25	Pass
-20C 120V	ax20	5200	5199.98	-20000	-3.85	25	Pass
-10C 120V	ax20	5200	5200	0	0	25	Pass
0C 120V	ax20	5200	5199.98	-20000	-3.85	25	Pass
10C 120V	ax20	5200	5199.98	-20000	-3.85	25	Pass
30C 120V	ax20	5200	5199.96	-40000	-7.69	25	Pass
40C 120V	ax20	5200	5199.98	-20000	-3.85	25	Pass
50C 120V	ax20	5200	5199.98	-20000	-3.85	25	Pass
20C 102V	ax20	5240	5239.98	-20000	-3.82	25	Pass
20C 120V	ax20	5240	5240	0	0	25	Pass
20C 138V	ax20	5240	5240	0	0	25	Pass
-20C 120V	ax20	5240	5239.98	-20000	-3.82	25	Pass
-10C 120V	ax20	5240	5239.98	-20000	-3.82	25	Pass
0C 120V	ax20	5240	5239.98	-20000	-3.82	25	Pass
10C 120V	ax20	5240	5239.98	-20000	-3.82	25	Pass
30C 120V	ax20	5240	5240	0	0	25	Pass

40C 120V	ax20	5240	5239.98	-20000	-3.82	25	Pass
50C 120V	ax20	5240	5240	0	0	25	Pass
20C 102V	ax40	5190	5190	0	0	25	Pass
20C 120V	ax40	5190	5189.96	-40000	-7.71	25	Pass
20C 138V	ax40	5190	5189.96	-40000	-7.71	25	Pass
-20C 120V	ax40	5190	5189.96	-40000	-7.71	25	Pass
-10C 120V	ax40	5190	5189.96	-40000	-7.71	25	Pass
0C 120V	ax40	5190	5190	0	0	25	Pass
10C 120V	ax40	5190	5190	0	0	25	Pass
30C 120V	ax40	5190	5190	0	0	25	Pass
40C 120V	ax40	5190	5189.96	-40000	-7.71	25	Pass
50C 120V	ax40	5190	5190	0	0	25	Pass
20C 102V	ax40	5230	5229.96	-40000	-7.65	25	Pass
20C 120V	ax40	5230	5229.96	-40000	-7.65	25	Pass
20C 138V	ax40	5230	5229.96	-40000	-7.65	25	Pass
-20C 120V	ax40	5230	5229.96	-40000	-7.65	25	Pass
-10C 120V	ax40	5230	5230	0	0	25	Pass
0C 120V	ax40	5230	5230	0	0	25	Pass
10C 120V	ax40	5230	5229.96	-40000	-7.65	25	Pass
30C 120V	ax40	5230	5229.96	-40000	-7.65	25	Pass
40C 120V	ax40	5230	5230	0	0	25	Pass
50C 120V	ax40	5230	5230	0	0	25	Pass
20C 102V	a	5745	5744.98	-20000	-3.48	25	Pass
20C 120V	a	5745	5744.98	-20000	-3.48	25	Pass
20C 138V	a	5745	5745.02	20000	3.48	25	Pass
-20C 120V	a	5745	5745	0	0	25	Pass
-10C 120V	a	5745	5744.98	-20000	-3.48	25	Pass
0C 120V	a	5745	5745	0	0	25	Pass
10C 120V	a	5745	5744.98	-20000	-3.48	25	Pass
30C 120V	a	5745	5744.98	-20000	-3.48	25	Pass
40C 120V	a	5745	5745	0	0	25	Pass
50C 120V	a	5745	5745	0	0	25	Pass
20C 102V	a	5785	5785	0	0	25	Pass
20C 120V	a	5785	5785	0	0	25	Pass
20C 138V	a	5785	5784.98	-20000	-3.46	25	Pass
-20C 120V	a	5785	5785	0	0	25	Pass
-10C 120V	a	5785	5785	0	0	25	Pass
0C 120V	a	5785	5784.98	-20000	-3.46	25	Pass
10C 120V	a	5785	5785	0	0	25	Pass
30C 120V	a	5785	5784.98	-20000	-3.46	25	Pass
40C 120V	a	5785	5785	0	0	25	Pass
50C 120V	a	5785	5784.98	-20000	-3.46	25	Pass
20C 102V	a	5825	5824.98	-20000	-3.43	25	Pass
20C 120V	a	5825	5824.98	-20000	-3.43	25	Pass
20C 138V	a	5825	5825	0	0	25	Pass
-20C 120V	a	5825	5824.98	-20000	-3.43	25	Pass
-10C 120V	a	5825	5825	0	0	25	Pass
0C 120V	a	5825	5825	0	0	25	Pass
10C 120V	a	5825	5825	0	0	25	Pass
30C 120V	a	5825	5825	0	0	25	Pass
40C 120V	a	5825	5824.98	-20000	-3.43	25	Pass
50C 120V	a	5825	5824.98	-20000	-3.43	25	Pass
20C 102V	n20	5745	5745	0	0	25	Pass
20C 120V	n20	5745	5745	0	0	25	Pass
20C 138V	n20	5745	5744.98	-20000	-3.48	25	Pass


-20C 120V	n20	5745	5744.98	-20000	-3.48	25	Pass
-10C 120V	n20	5745	5745	0	0	25	Pass
0C 120V	n20	5745	5745.02	20000	3.48	25	Pass
10C 120V	n20	5745	5745	0	0	25	Pass
30C 120V	n20	5745	5745.02	20000	3.48	25	Pass
40C 120V	n20	5745	5745	0	0	25	Pass
50C 120V	n20	5745	5745	0	0	25	Pass
20C 102V	n20	5785	5785.02	20000	3.46	25	Pass
20C 120V	n20	5785	5785	0	0	25	Pass
20C 138V	n20	5785	5785	0	0	25	Pass
-20C 120V	n20	5785	5785	0	0	25	Pass
-10C 120V	n20	5785	5785	0	0	25	Pass
0C 120V	n20	5785	5784.98	-20000	-3.46	25	Pass
10C 120V	n20	5785	5784.98	-20000	-3.46	25	Pass
30C 120V	n20	5785	5785	0	0	25	Pass
40C 120V	n20	5785	5785	0	0	25	Pass
50C 120V	n20	5785	5784.98	-20000	-3.46	25	Pass
20C 102V	n20	5825	5825	0	0	25	Pass
20C 120V	n20	5825	5825	0	0	25	Pass
20C 138V	n20	5825	5825	0	0	25	Pass
-20C 120V	n20	5825	5824.98	-20000	-3.43	25	Pass
-10C 120V	n20	5825	5825	0	0	25	Pass
0C 120V	n20	5825	5825	0	0	25	Pass
10C 120V	n20	5825	5825	0	0	25	Pass
30C 120V	n20	5825	5825	0	0	25	Pass
40C 120V	n20	5825	5825	0	0	25	Pass
50C 120V	n20	5825	5824.98	-20000	-3.43	25	Pass
20C 102V	n40	5755	5754.96	-40000	-6.95	25	Pass
20C 120V	n40	5755	5755	0	0	25	Pass
20C 138V	n40	5755	5755	0	0	25	Pass
-20C 120V	n40	5755	5755	0	0	25	Pass
-10C 120V	n40	5755	5755	0	0	25	Pass
0C 120V	n40	5755	5755	0	0	25	Pass
10C 120V	n40	5755	5755	0	0	25	Pass
30C 120V	n40	5755	5755	0	0	25	Pass
40C 120V	n40	5755	5755	0	0	25	Pass
50C 120V	n40	5755	5755.04	40000	6.95	25	Pass
20C 102V	n40	5795	5794.96	-40000	-6.9	25	Pass
20C 120V	n40	5795	5794.96	-40000	-6.9	25	Pass
20C 138V	n40	5795	5794.96	-40000	-6.9	25	Pass
-20C 120V	n40	5795	5794.96	-40000	-6.9	25	Pass
-10C 120V	n40	5795	5794.96	-40000	-6.9	25	Pass
0C 120V	n40	5795	5795	0	0	25	Pass
10C 120V	n40	5795	5794.96	-40000	-6.9	25	Pass
30C 120V	n40	5795	5794.96	-40000	-6.9	25	Pass
40C 120V	n40	5795	5795	0	0	25	Pass
50C 120V	n40	5795	5794.96	-40000	-6.9	25	Pass
20C 102V	ac20	5745	5744.98	-20000	-3.48	25	Pass
20C 120V	ac20	5745	5744.96	-40000	-6.96	25	Pass
20C 138V	ac20	5745	5744.98	-20000	-3.48	25	Pass
-20C 120V	ac20	5745	5744.96	-40000	-6.96	25	Pass
-10C 120V	ac20	5745	5745	0	0	25	Pass
0C 120V	ac20	5745	5744.96	-40000	-6.96	25	Pass
10C 120V	ac20	5745	5744.98	-20000	-3.48	25	Pass
30C 120V	ac20	5745	5744.96	-40000	-6.96	25	Pass

40C 120V	ac20	5745	5744.98	-20000	-3.48	25	Pass
50C 120V	ac20	5745	5744.96	-40000	-6.96	25	Pass
20C 102V	ac20	5785	5784.98	-20000	-3.46	25	Pass
20C 120V	ac20	5785	5784.98	-20000	-3.46	25	Pass
20C 138V	ac20	5785	5785	0	0	25	Pass
-20C 120V	ac20	5785	5784.98	-20000	-3.46	25	Pass
-10C 120V	ac20	5785	5784.96	-40000	-6.91	25	Pass
0C 120V	ac20	5785	5784.98	-20000	-3.46	25	Pass
10C 120V	ac20	5785	5784.96	-40000	-6.91	25	Pass
30C 120V	ac20	5785	5784.98	-20000	-3.46	25	Pass
40C 120V	ac20	5785	5784.98	-20000	-3.46	25	Pass
50C 120V	ac20	5785	5784.96	-40000	-6.91	25	Pass
20C 102V	ac20	5825	5824.96	-40000	-6.87	25	Pass
20C 120V	ac20	5825	5824.96	-40000	-6.87	25	Pass
20C 138V	ac20	5825	5824.98	-20000	-3.43	25	Pass
-20C 120V	ac20	5825	5824.98	-20000	-3.43	25	Pass
-10C 120V	ac20	5825	5824.98	-20000	-3.43	25	Pass
0C 120V	ac20	5825	5824.96	-40000	-6.87	25	Pass
10C 120V	ac20	5825	5824.98	-20000	-3.43	25	Pass
30C 120V	ac20	5825	5824.98	-20000	-3.43	25	Pass
40C 120V	ac20	5825	5824.98	-20000	-3.43	25	Pass
50C 120V	ac20	5825	5824.96	-40000	-6.87	25	Pass
20C 102V	ac40	5755	5754.96	-40000	-6.95	25	Pass
20C 120V	ac40	5755	5754.96	-40000	-6.95	25	Pass
20C 138V	ac40	5755	5755	0	0	25	Pass
-20C 120V	ac40	5755	5755	0	0	25	Pass
-10C 120V	ac40	5755	5754.96	-40000	-6.95	25	Pass
0C 120V	ac40	5755	5754.96	-40000	-6.95	25	Pass
10C 120V	ac40	5755	5755	0	0	25	Pass
30C 120V	ac40	5755	5755	0	0	25	Pass
40C 120V	ac40	5755	5754.96	-40000	-6.95	25	Pass
50C 120V	ac40	5755	5754.96	-40000	-6.95	25	Pass
20C 102V	ac40	5795	5794.96	-40000	-6.9	25	Pass
20C 120V	ac40	5795	5794.96	-40000	-6.9	25	Pass
20C 138V	ac40	5795	5794.96	-40000	-6.9	25	Pass
-20C 120V	ac40	5795	5794.96	-40000	-6.9	25	Pass
-10C 120V	ac40	5795	5794.96	-40000	-6.9	25	Pass
0C 120V	ac40	5795	5795	0	0	25	Pass
10C 120V	ac40	5795	5794.96	-40000	-6.9	25	Pass
30C 120V	ac40	5795	5794.92	-80000	-13.81	25	Pass
40C 120V	ac40	5795	5794.96	-40000	-6.9	25	Pass
50C 120V	ac40	5795	5794.96	-40000	-6.9	25	Pass
20C 102V	ax20	5745	5744.96	-40000	-6.96	25	Pass
20C 120V	ax20	5745	5744.98	-20000	-3.48	25	Pass
20C 138V	ax20	5745	5744.98	-20000	-3.48	25	Pass
-20C 120V	ax20	5745	5744.96	-40000	-6.96	25	Pass
-10C 120V	ax20	5745	5744.96	-40000	-6.96	25	Pass
0C 120V	ax20	5745	5744.96	-40000	-6.96	25	Pass
10C 120V	ax20	5745	5744.96	-40000	-6.96	25	Pass
30C 120V	ax20	5745	5744.98	-20000	-3.48	25	Pass
40C 120V	ax20	5745	5744.98	-20000	-3.48	25	Pass
50C 120V	ax20	5745	5744.96	-40000	-6.96	25	Pass
20C 102V	ax20	5785	5784.98	-20000	-3.46	25	Pass
20C 120V	ax20	5785	5784.98	-20000	-3.46	25	Pass
20C 138V	ax20	5785	5784.98	-20000	-3.46	25	Pass

-20C 120V	ax20	5785	5784.98	-20000	-3.46	25	Pass
-10C 120V	ax20	5785	5784.98	-20000	-3.46	25	Pass
0C 120V	ax20	5785	5784.98	-20000	-3.46	25	Pass
10C 120V	ax20	5785	5784.98	-20000	-3.46	25	Pass
30C 120V	ax20	5785	5784.98	-20000	-3.46	25	Pass
40C 120V	ax20	5785	5784.96	-40000	-6.91	25	Pass
50C 120V	ax20	5785	5784.98	-20000	-3.46	25	Pass
20C 102V	ax20	5825	5824.96	-40000	-6.87	25	Pass
20C 120V	ax20	5825	5824.98	-20000	-3.43	25	Pass
20C 138V	ax20	5825	5824.98	-20000	-3.43	25	Pass
-20C 120V	ax20	5825	5824.96	-40000	-6.87	25	Pass
-10C 120V	ax20	5825	5824.98	-20000	-3.43	25	Pass
0C 120V	ax20	5825	5824.96	-40000	-6.87	25	Pass
10C 120V	ax20	5825	5824.98	-20000	-3.43	25	Pass
30C 120V	ax20	5825	5824.98	-20000	-3.43	25	Pass
40C 120V	ax20	5825	5824.98	-20000	-3.43	25	Pass
50C 120V	ax20	5825	5824.96	-40000	-6.87	25	Pass
20C 102V	ax40	5755	5754.96	-40000	-6.95	25	Pass
20C 120V	ax40	5755	5755	0	0	25	Pass
20C 138V	ax40	5755	5755	0	0	25	Pass
-20C 120V	ax40	5755	5755	0	0	25	Pass
-10C 120V	ax40	5755	5754.96	-40000	-6.95	25	Pass
0C 120V	ax40	5755	5754.96	-40000	-6.95	25	Pass
10C 120V	ax40	5755	5754.96	-40000	-6.95	25	Pass
30C 120V	ax40	5755	5754.96	-40000	-6.95	25	Pass
40C 120V	ax40	5755	5755	0	0	25	Pass
50C 120V	ax40	5755	5755	0	0	25	Pass
20C 102V	ax40	5795	5794.96	-40000	-6.9	25	Pass
20C 120V	ax40	5795	5794.96	-40000	-6.9	25	Pass
20C 138V	ax40	5795	5794.96	-40000	-6.9	25	Pass
-20C 120V	ax40	5795	5794.96	-40000	-6.9	25	Pass
-10C 120V	ax40	5795	5794.96	-40000	-6.9	25	Pass
0C 120V	ax40	5795	5794.96	-40000	-6.9	25	Pass
10C 120V	ax40	5795	5794.96	-40000	-6.9	25	Pass
30C 120V	ax40	5795	5794.96	-40000	-6.9	25	Pass
40C 120V	ax40	5795	5794.96	-40000	-6.9	25	Pass
50C 120V	ax40	5795	5794.96	-40000	-6.9	25	Pass

Test Graphs


Freq. Stability 20C 102V a 5180MHz

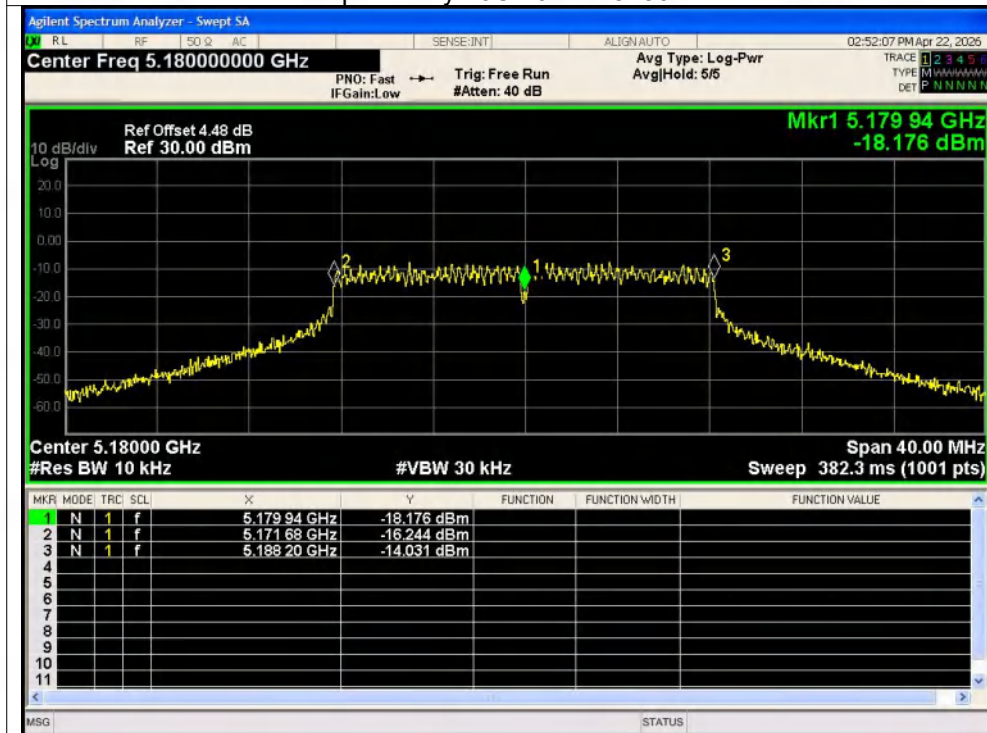


Freq. Stability 20C 120V a 5180MHz




Freq. Stability 20C 138V a 5180MHz

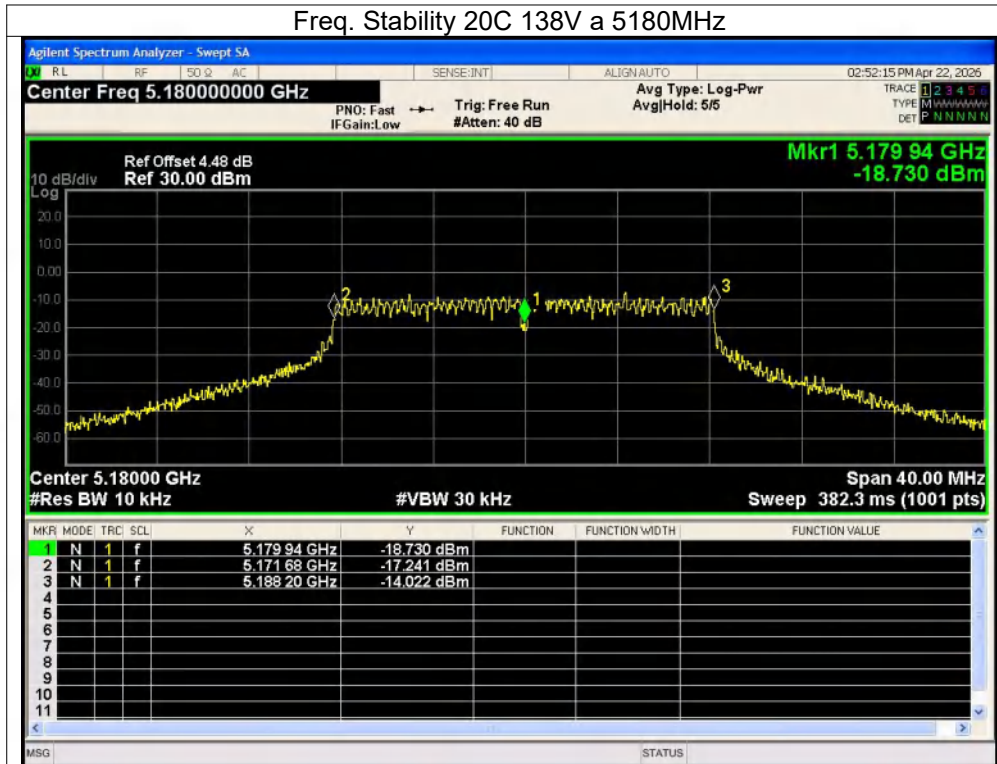


Freq. Stability -20C 120V a 5180MHz

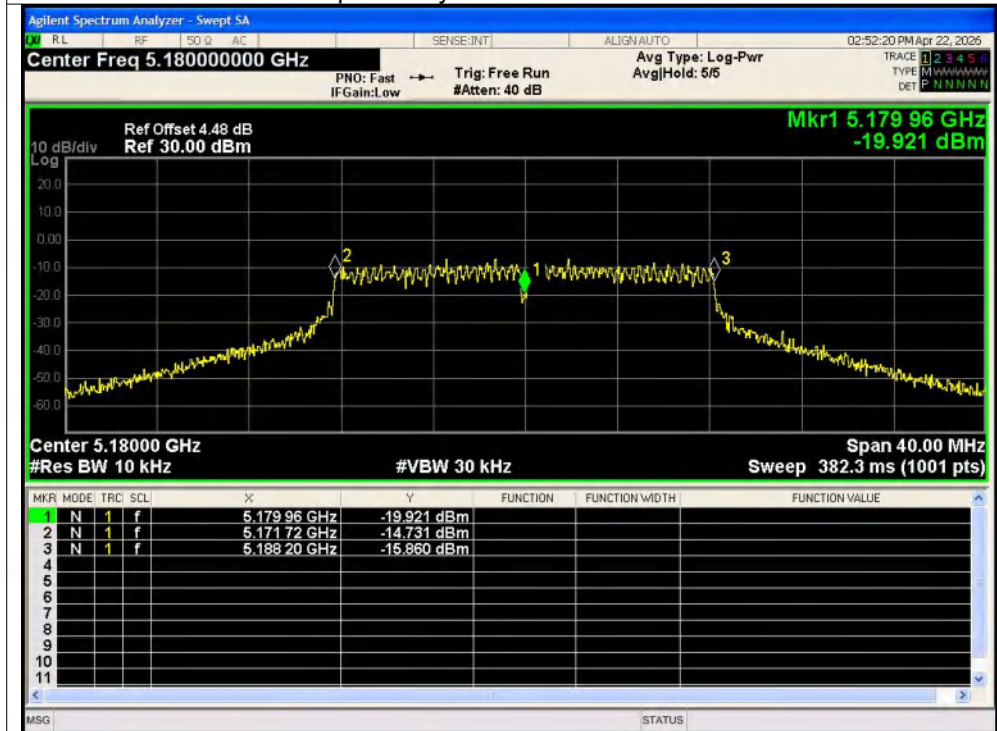


Freq. Stability -10C 120V a 5180MHz

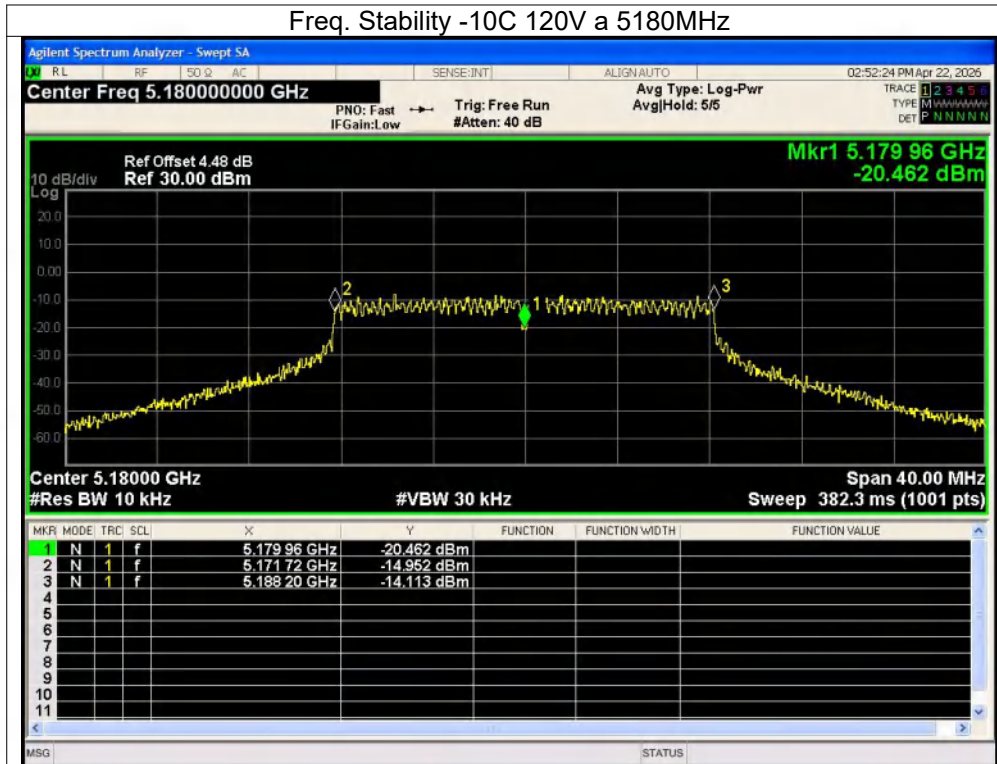


Freq. Stability 0C 120V a 5180MHz

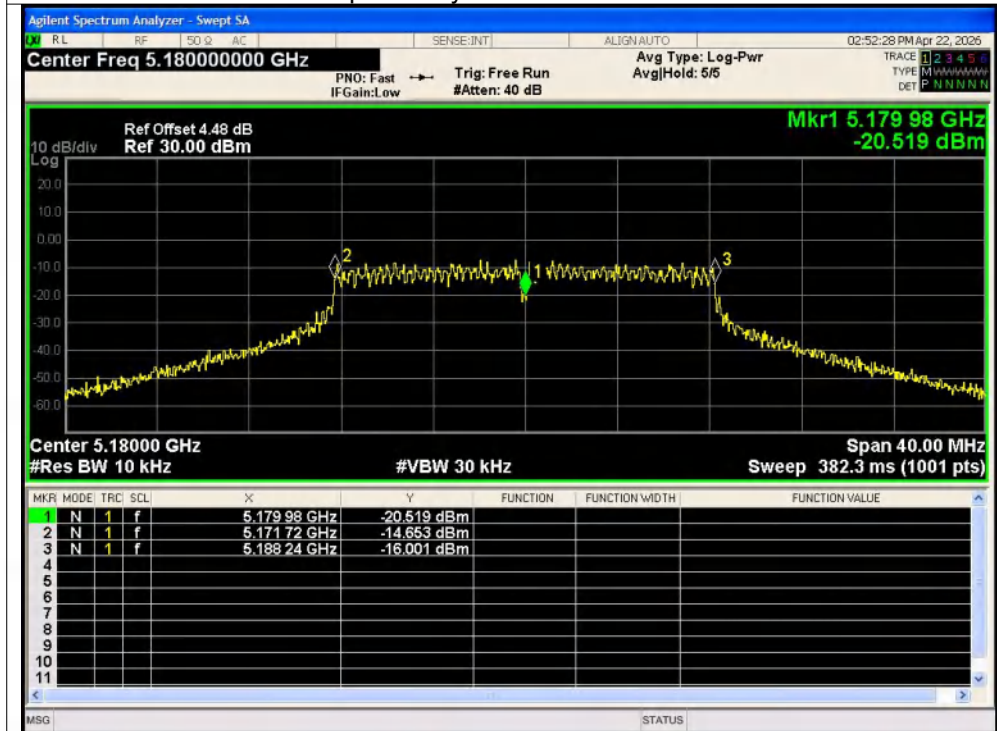


Freq. Stability 10C 120V a 5180MHz

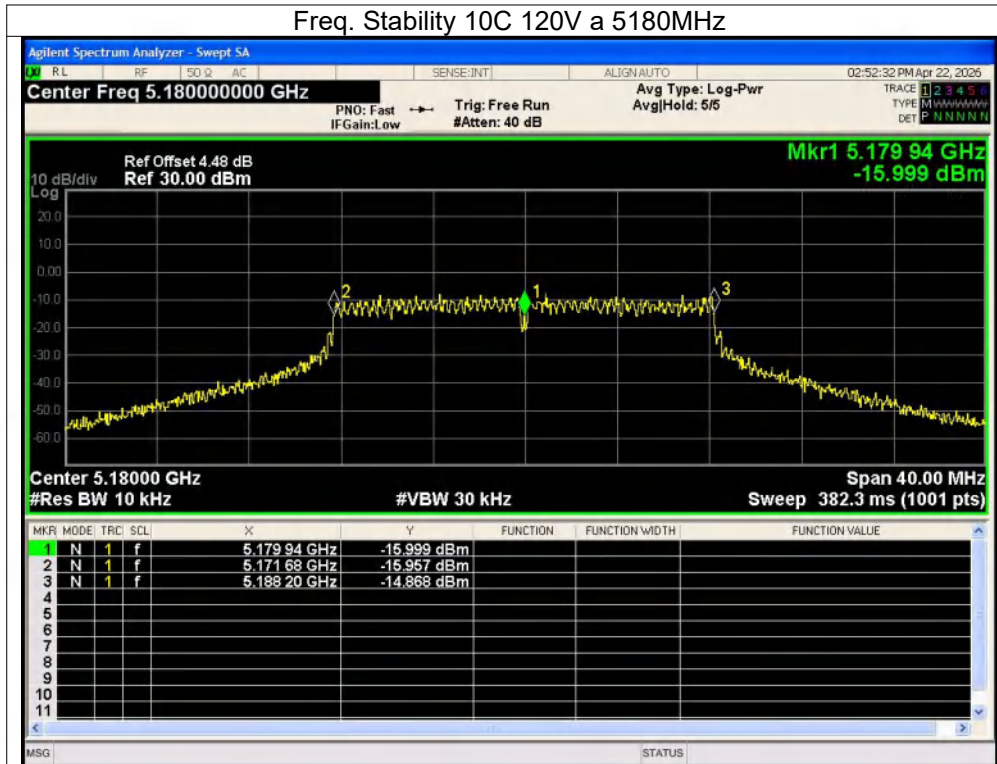


Freq. Stability 30C 120V a 5180MHz

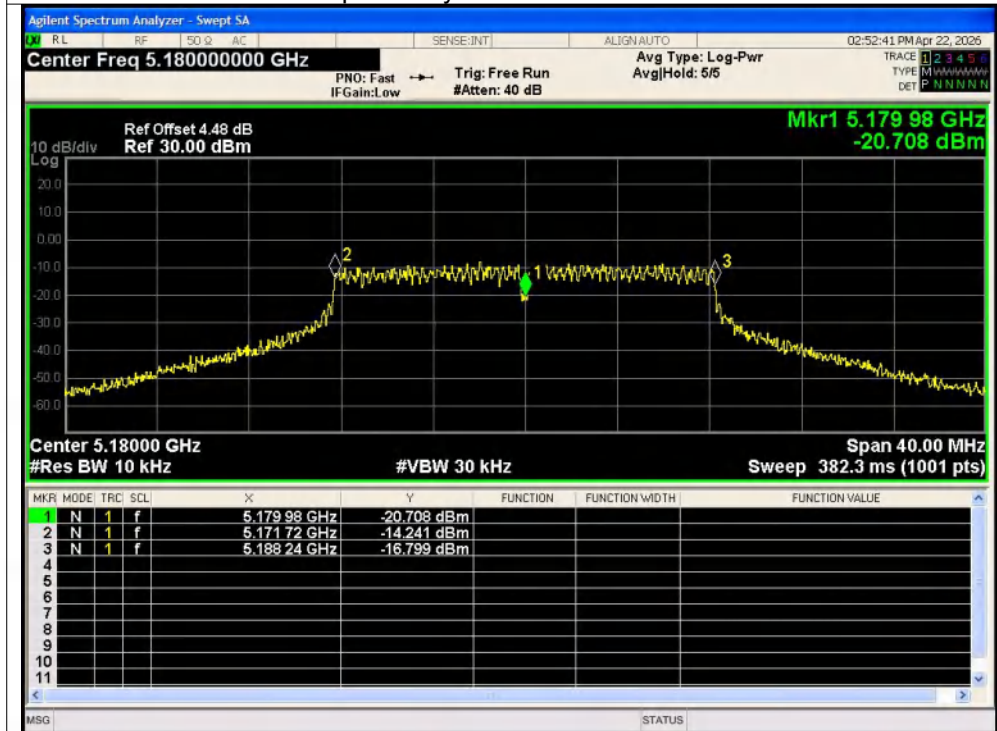


Freq. Stability 40C 120V a 5180MHz

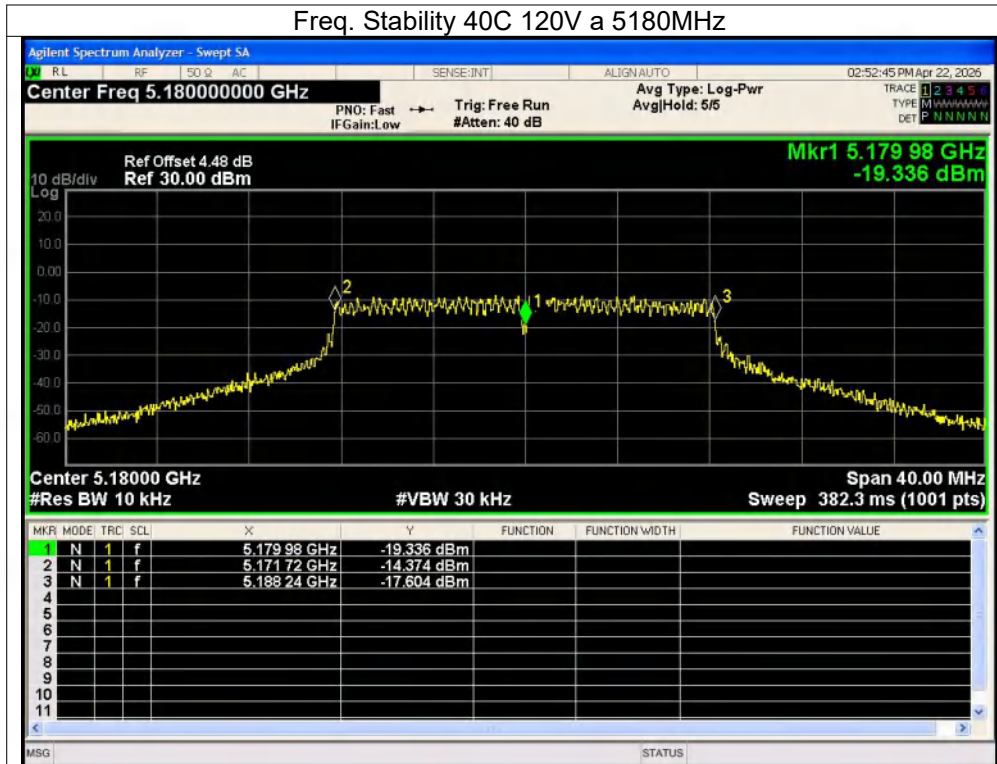


Freq. Stability 50C 120V a 5180MHz

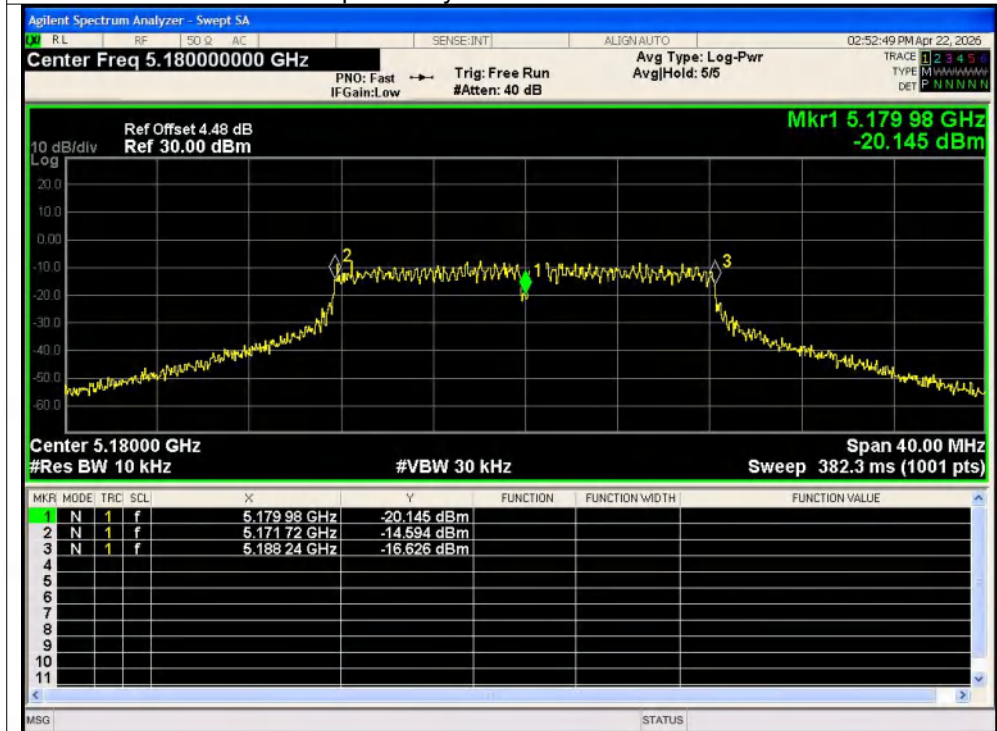


Freq. Stability 20C 102V a 5200MHz

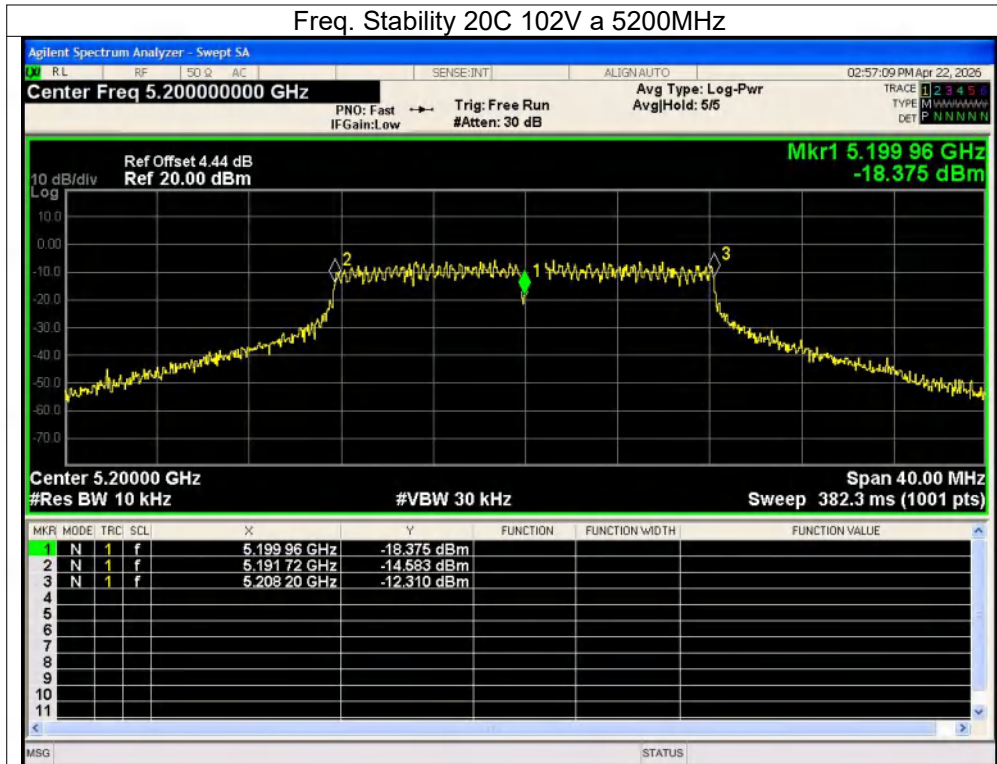


Freq. Stability 20C 120V a 5200MHz

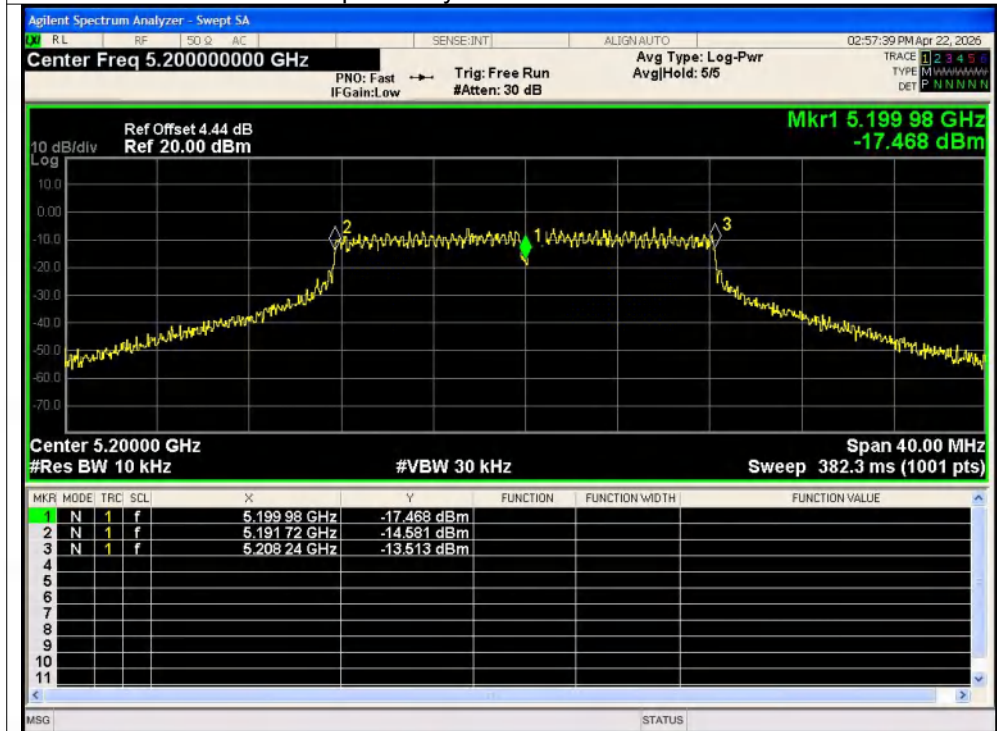


Freq. Stability 20C 138V a 5200MHz

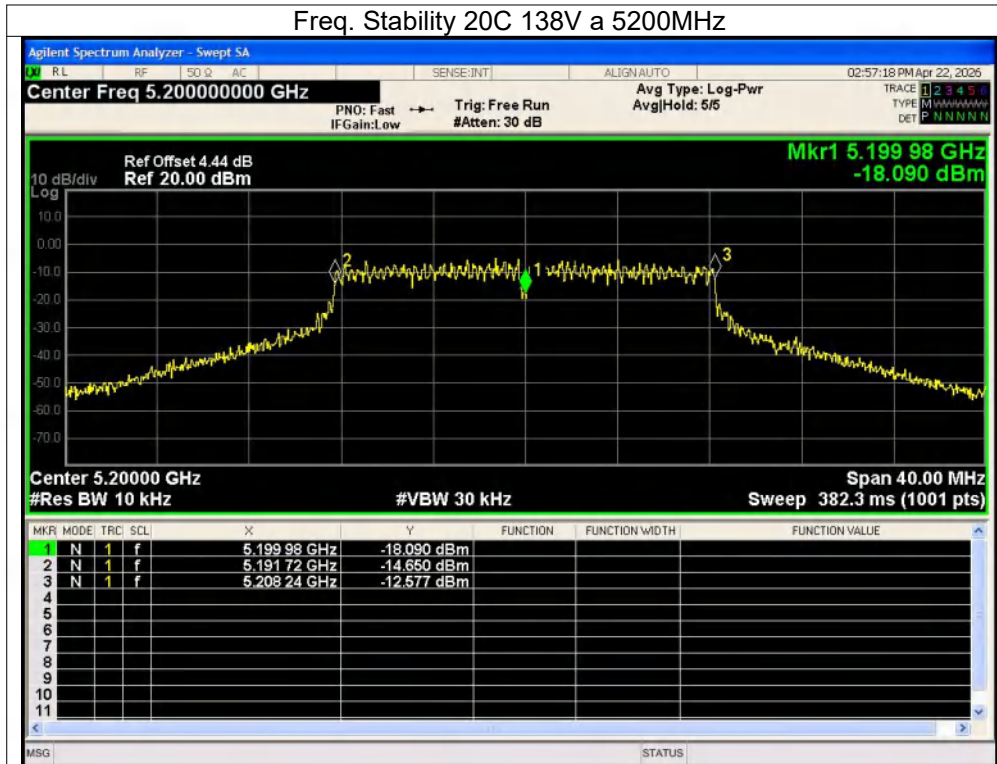


Freq. Stability -20C 120V a 5200MHz

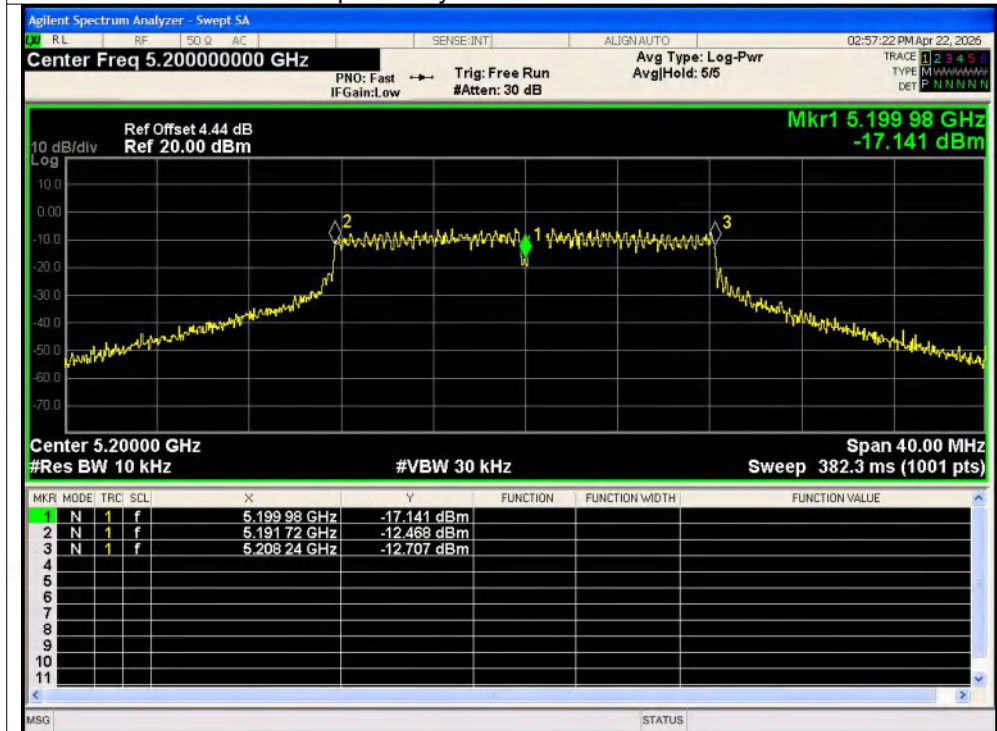


Freq. Stability -10C 120V a 5200MHz

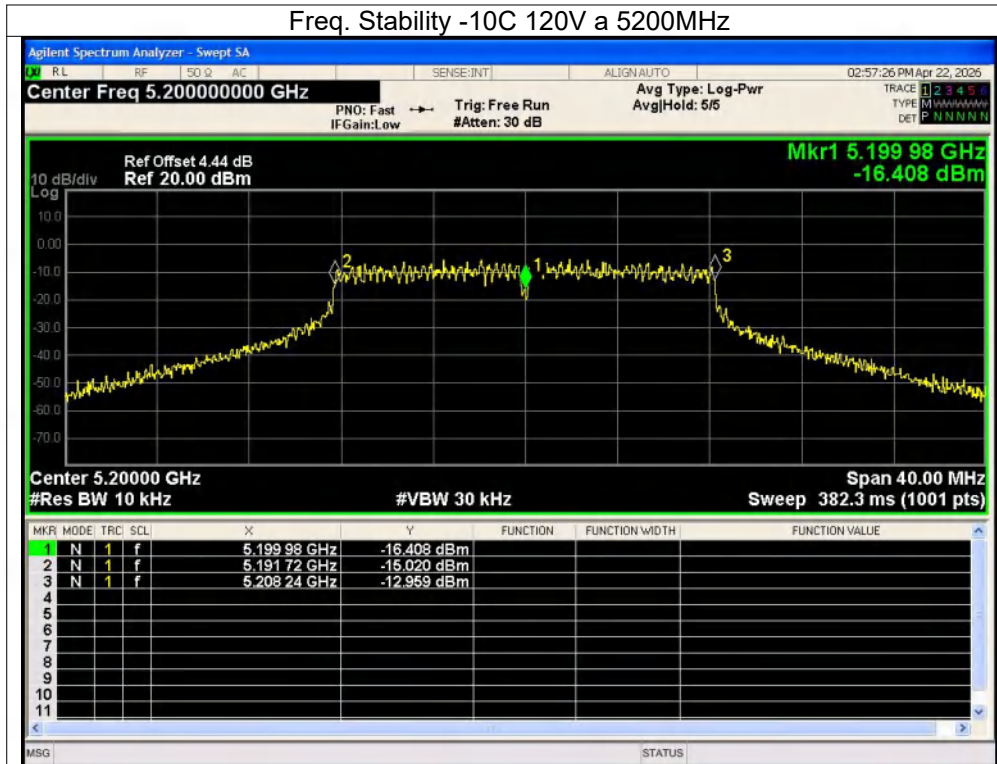


Freq. Stability 0C 120V a 5200MHz

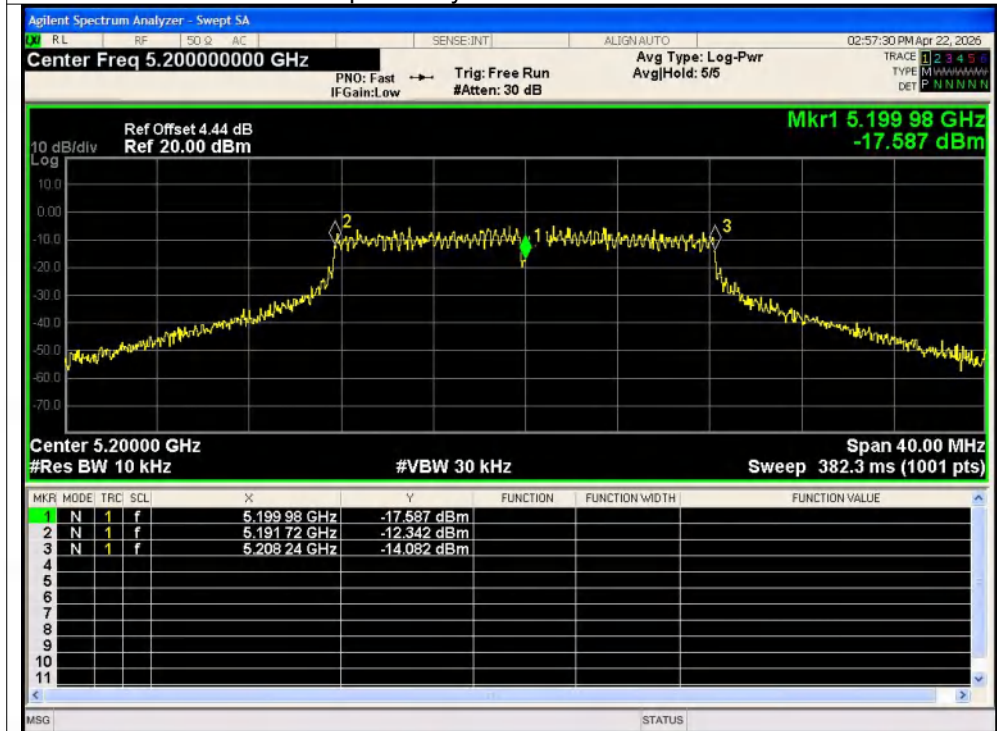


Freq. Stability 10C 120V a 5200MHz

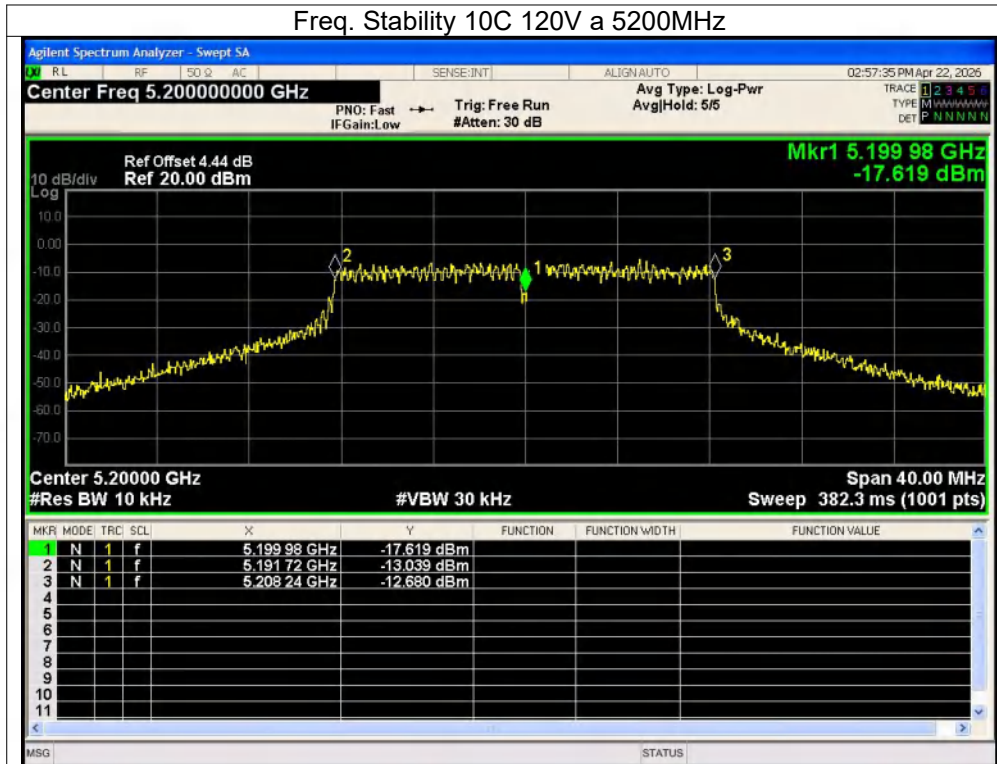


Freq. Stability 30C 120V a 5200MHz

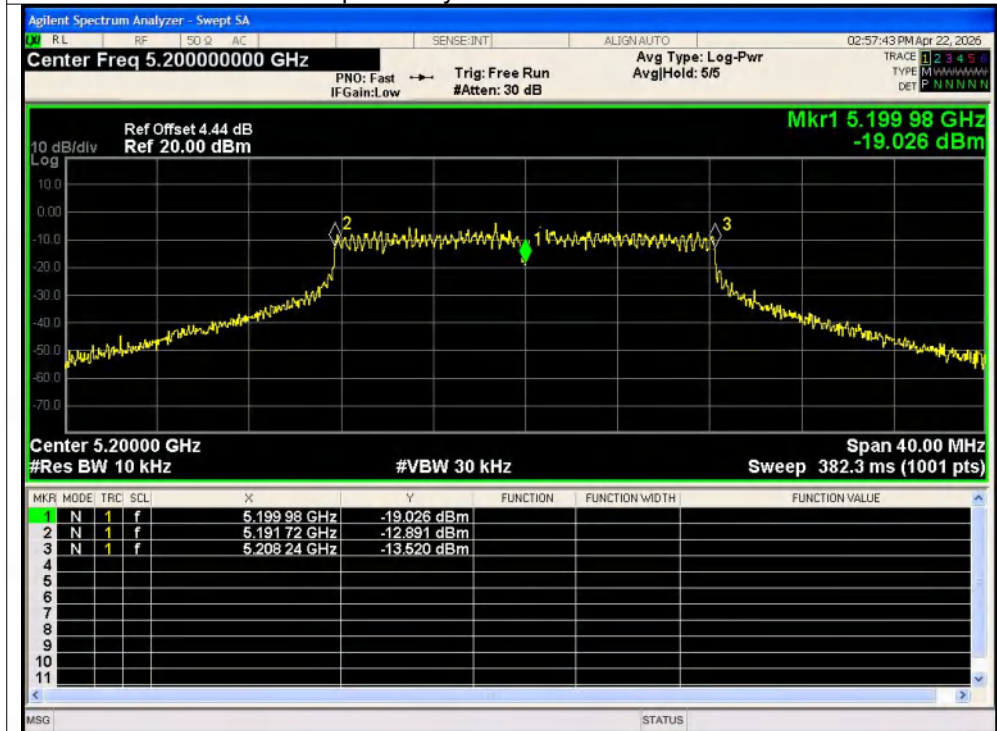


Freq. Stability 40C 120V a 5200MHz

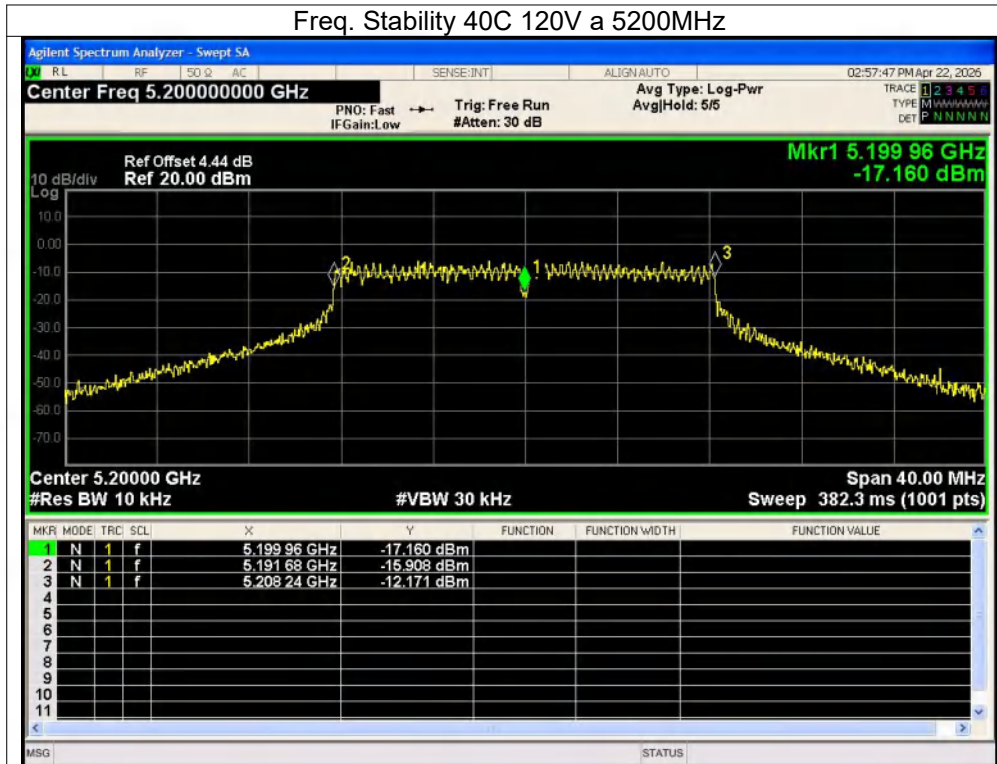


Freq. Stability 50C 120V a 5200MHz

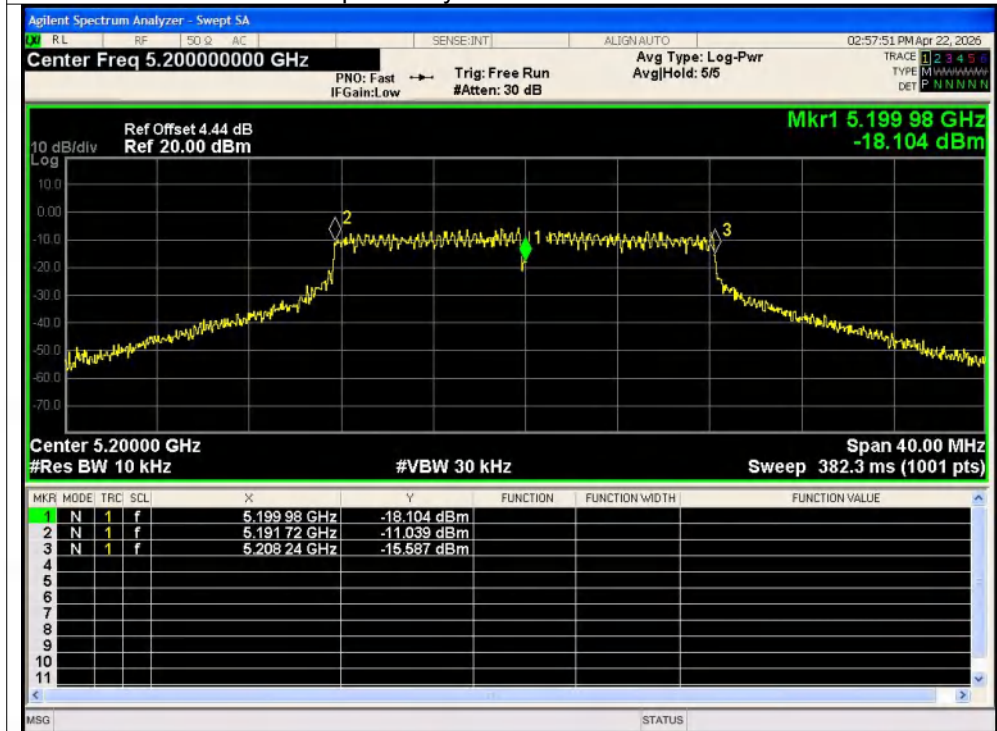


Freq. Stability 20C 102V a 5240MHz

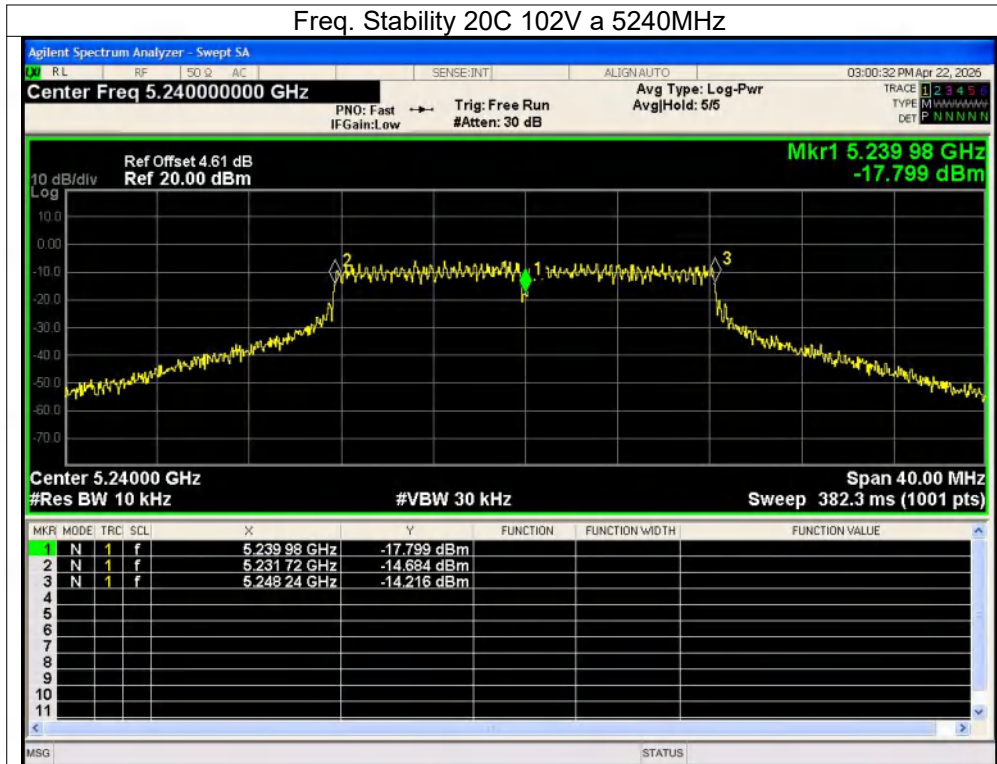


Freq. Stability 20C 120V a 5240MHz

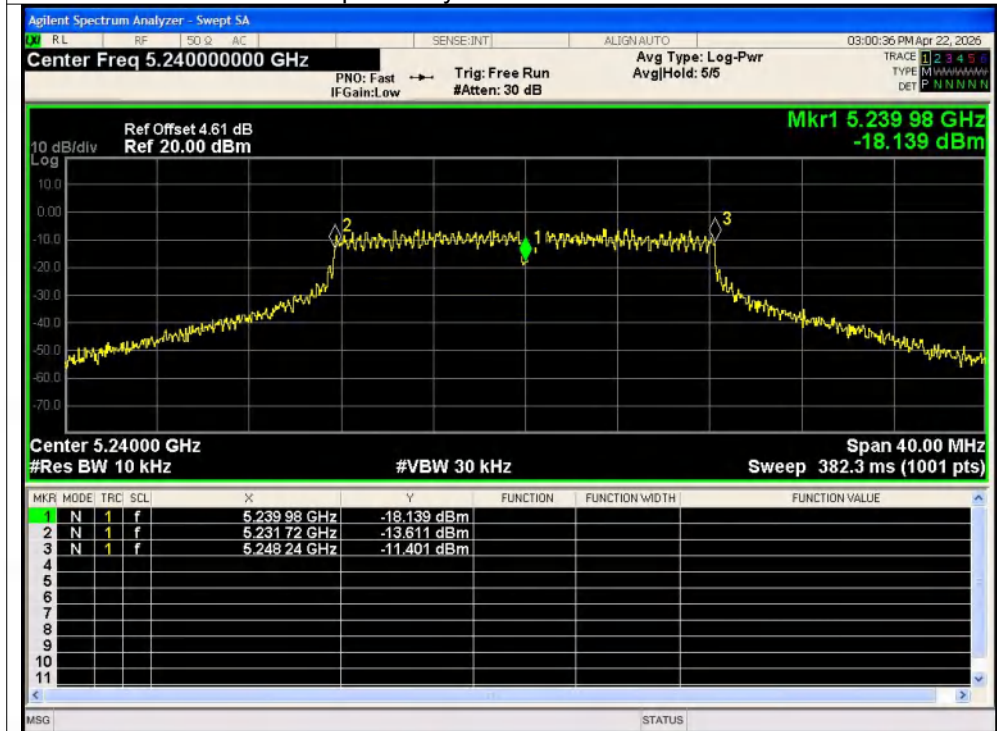


Freq. Stability 20C 138V a 5240MHz

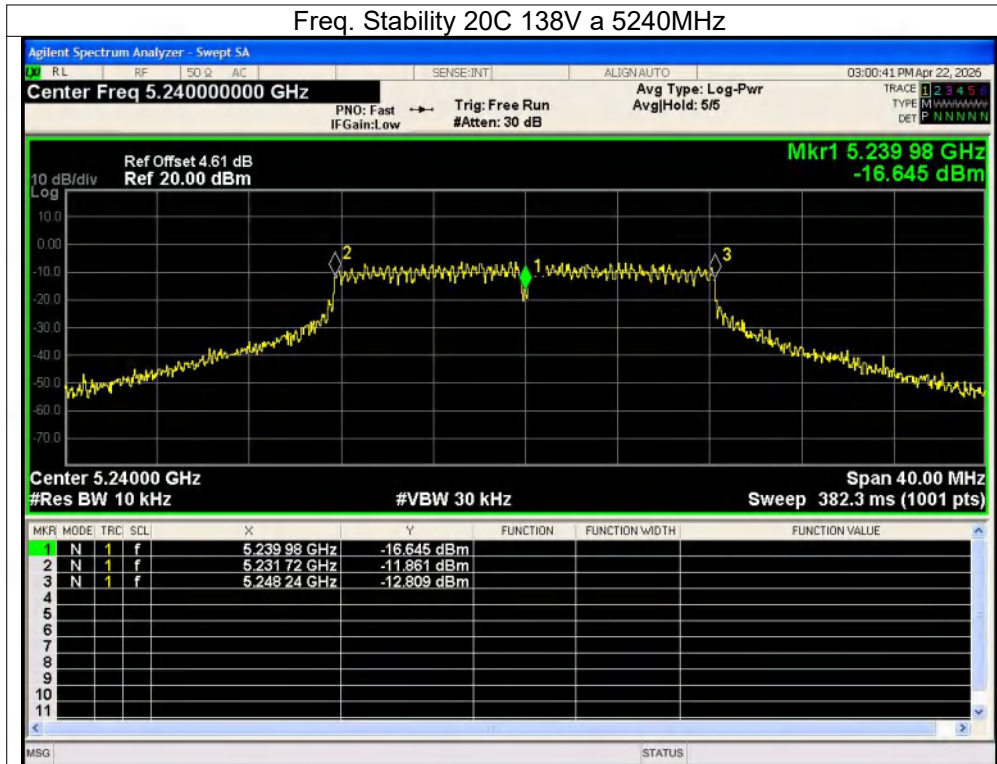


Freq. Stability -20C 120V a 5240MHz

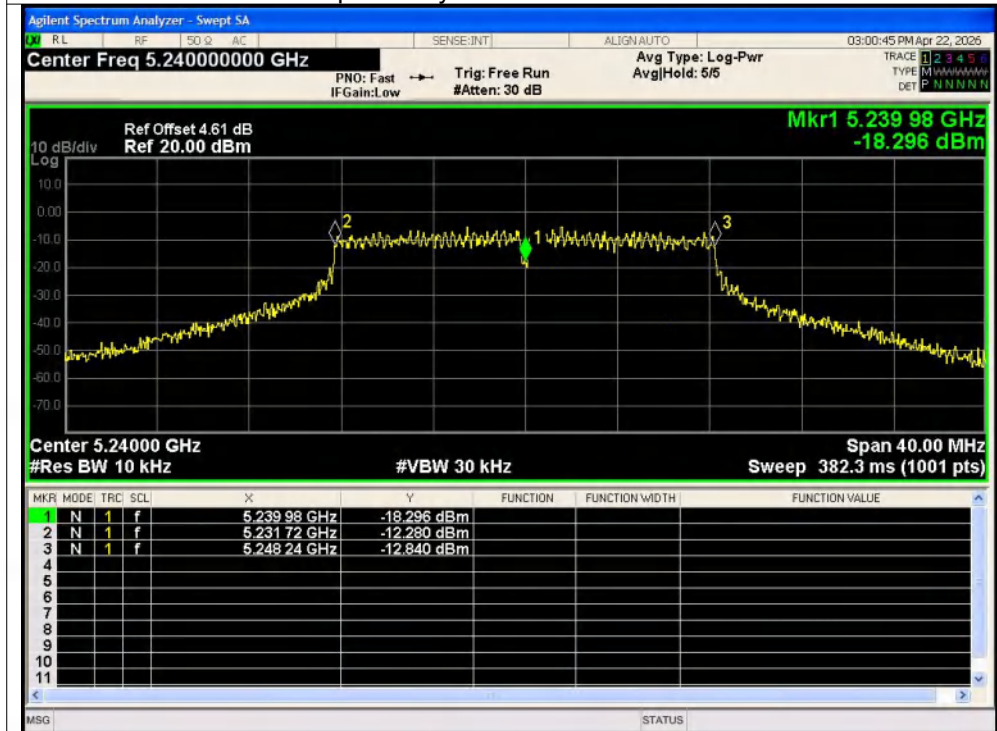


Freq. Stability -10C 120V a 5240MHz

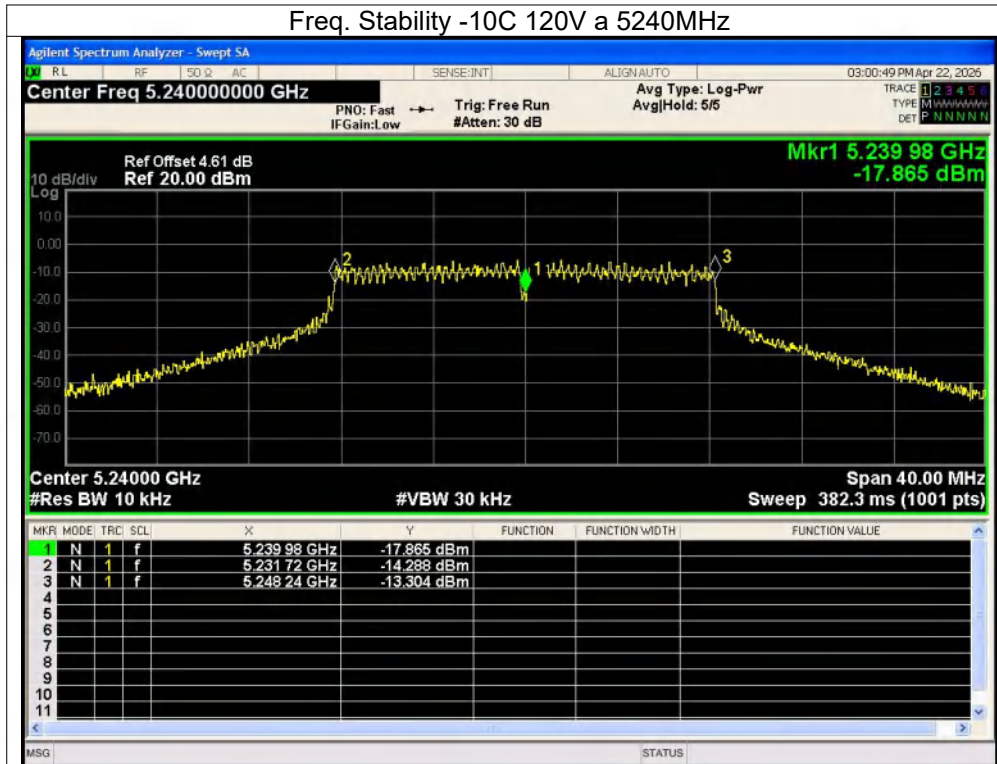


Freq. Stability 0C 120V a 5240MHz

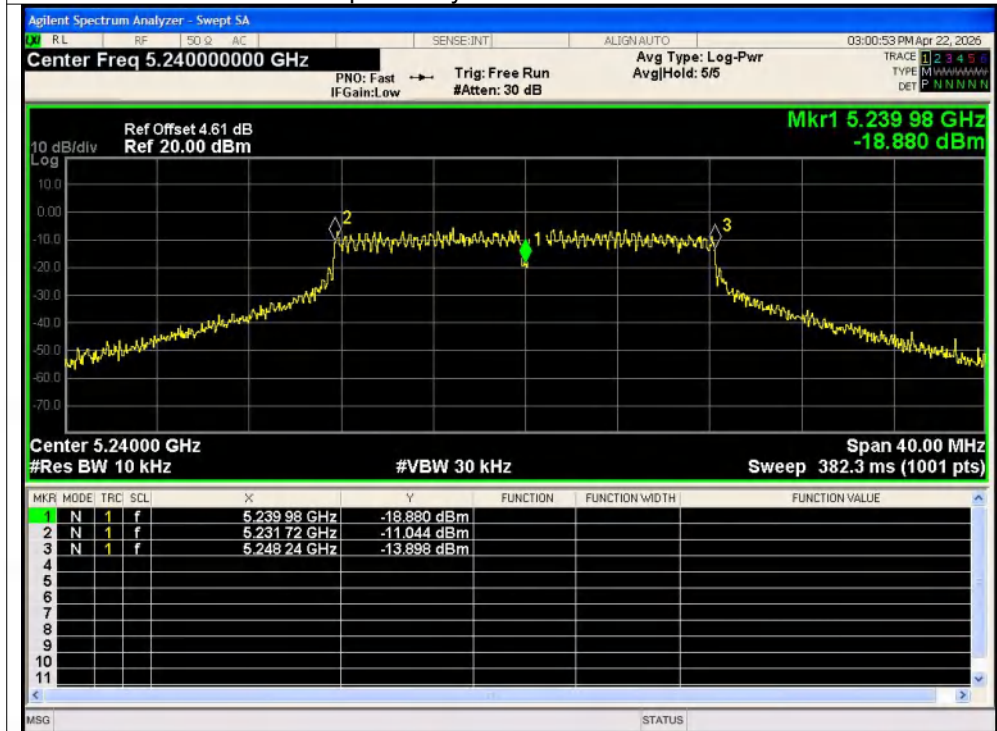


Freq. Stability 10C 120V a 5240MHz

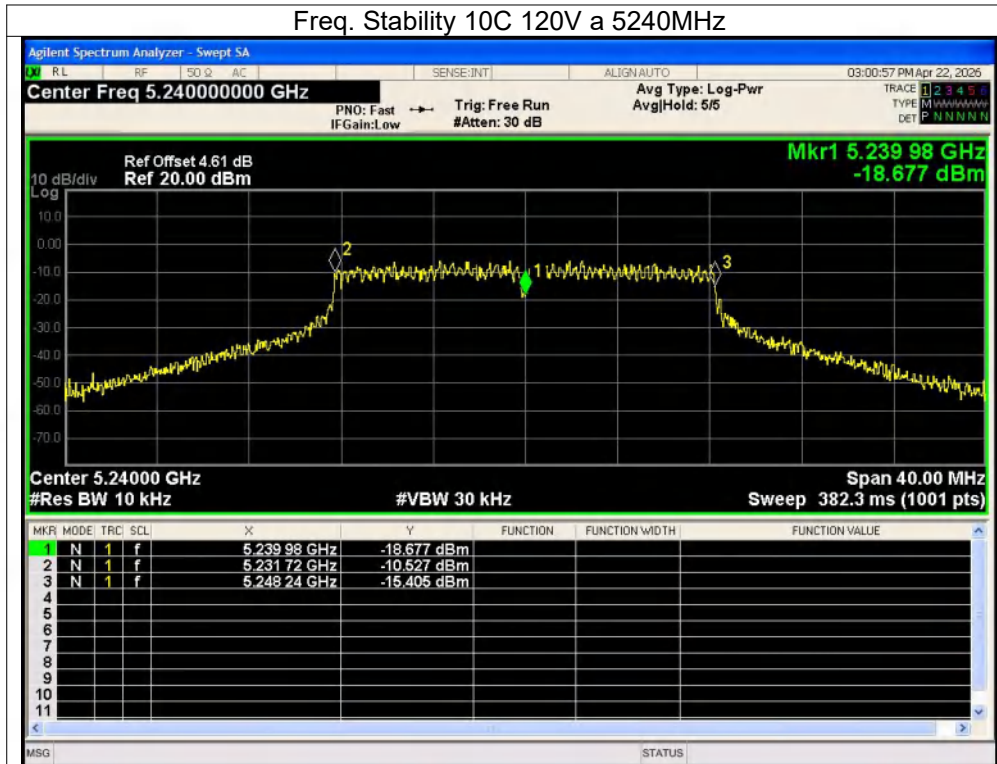


Freq. Stability 20C 120V a 5240MHz

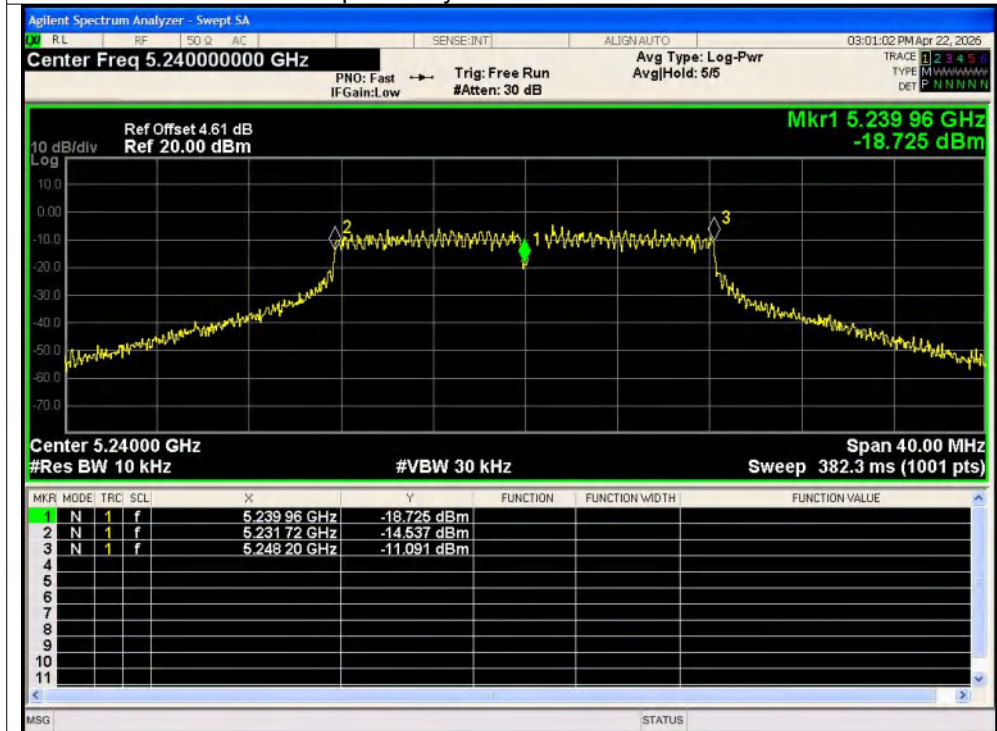


Freq. Stability 30C 120V a 5240MHz

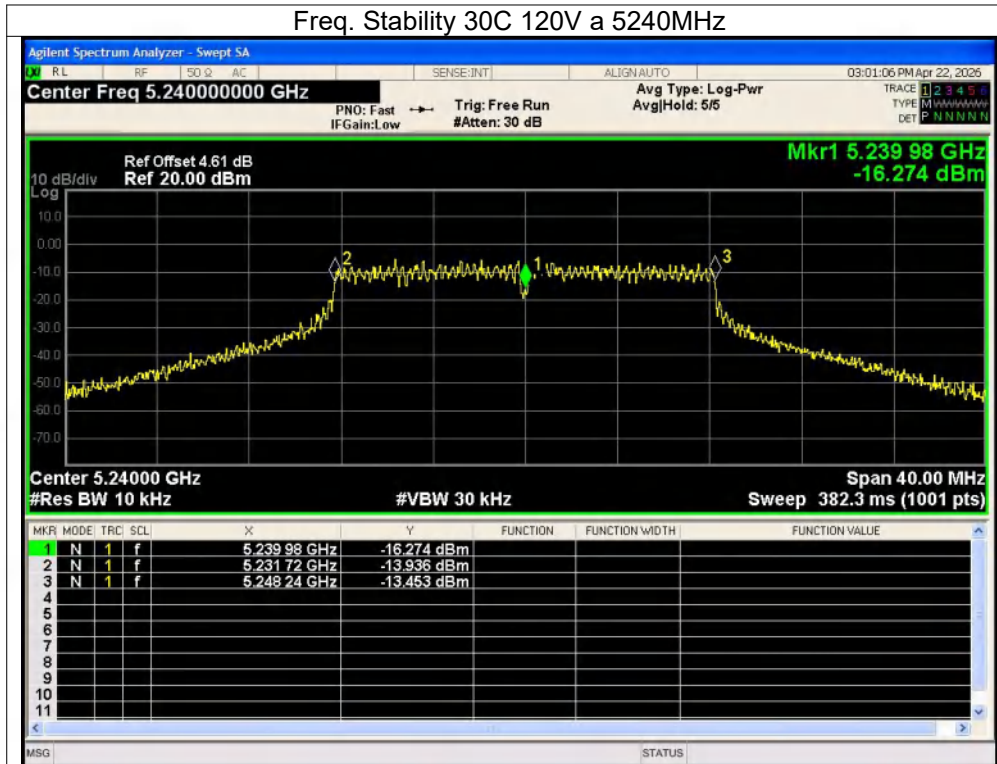


Freq. Stability 40C 120V a 5240MHz

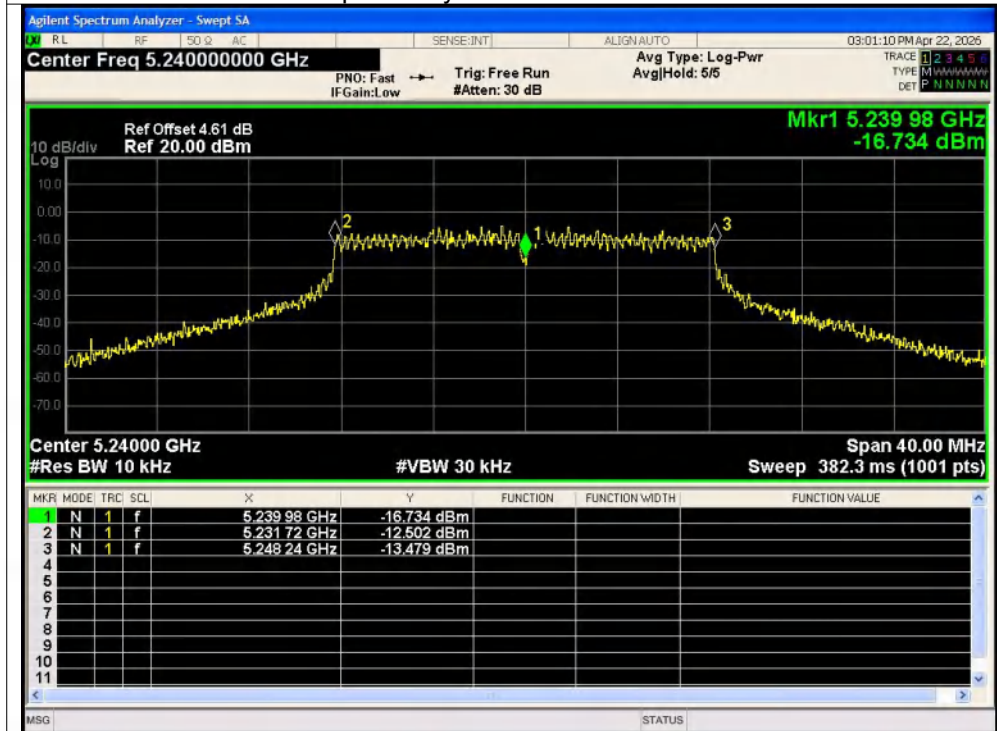


Freq. Stability 50C 120V a 5240MHz

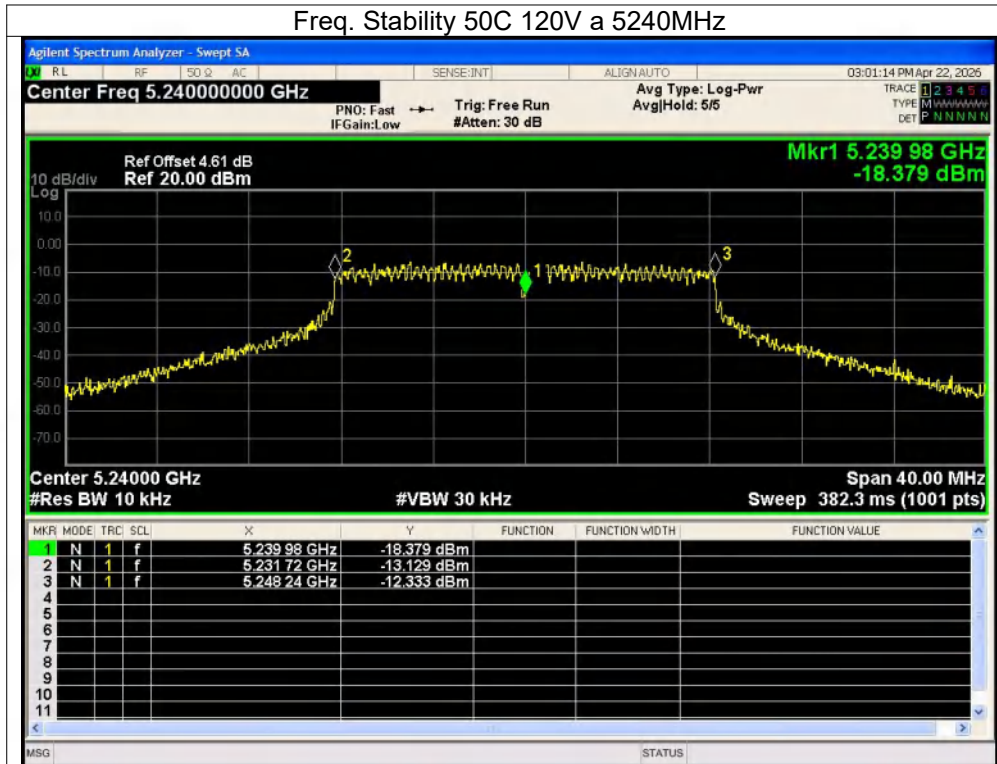


Freq. Stability 20C 102V n20 5180MHz

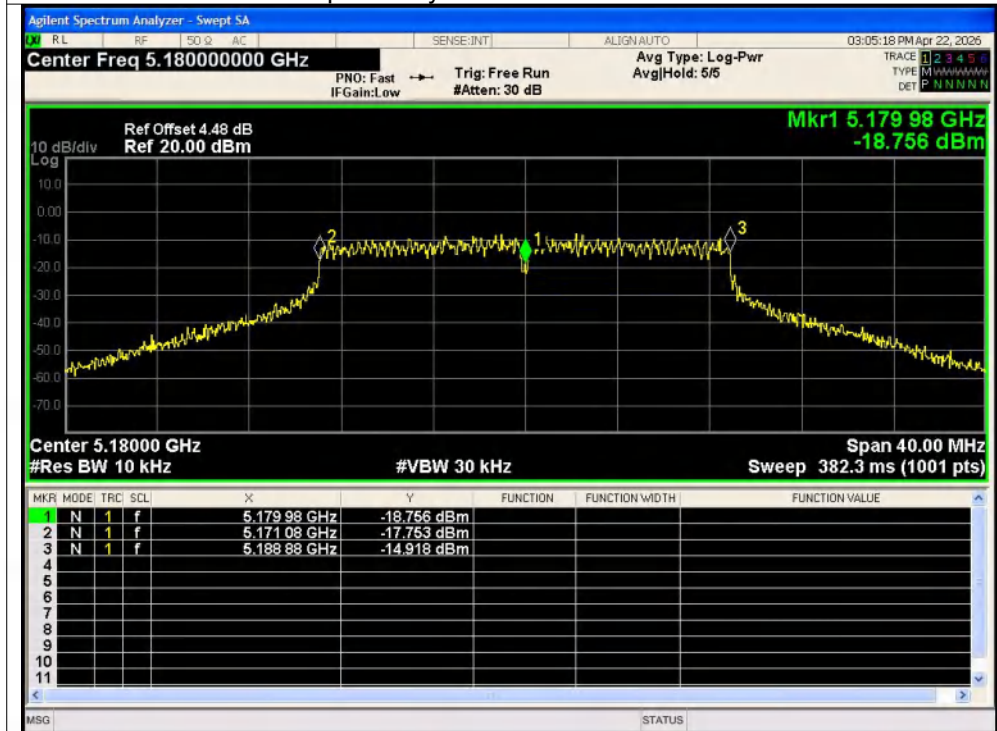


Freq. Stability 20C 120V n20 5180MHz

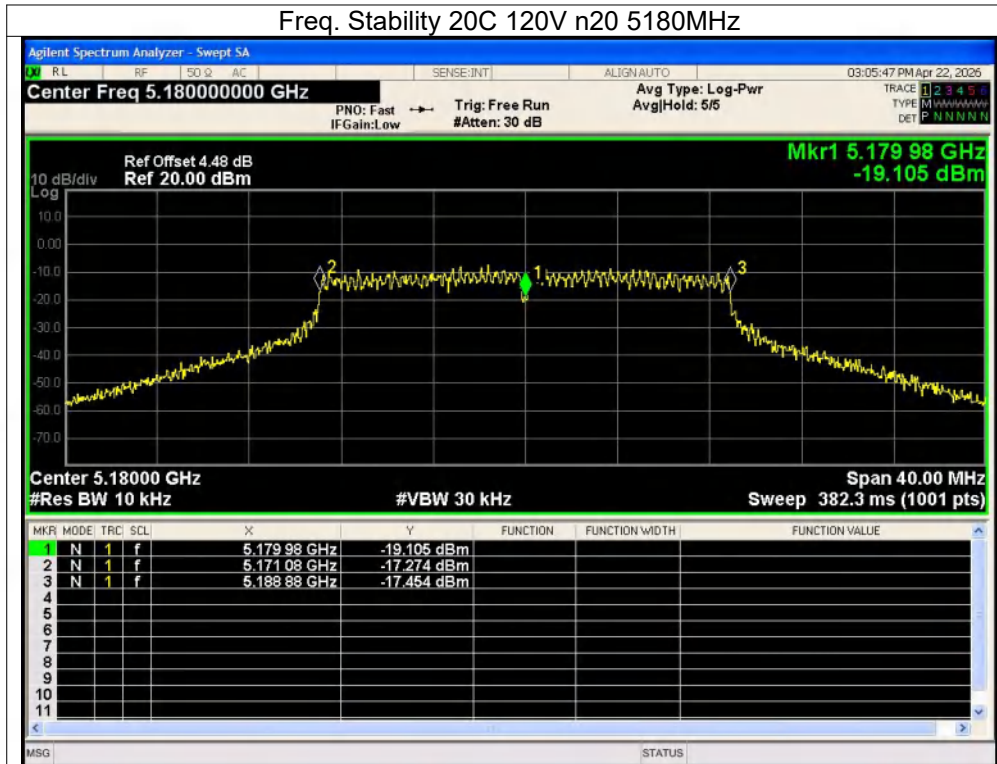


Freq. Stability 20C 138V n20 5180MHz

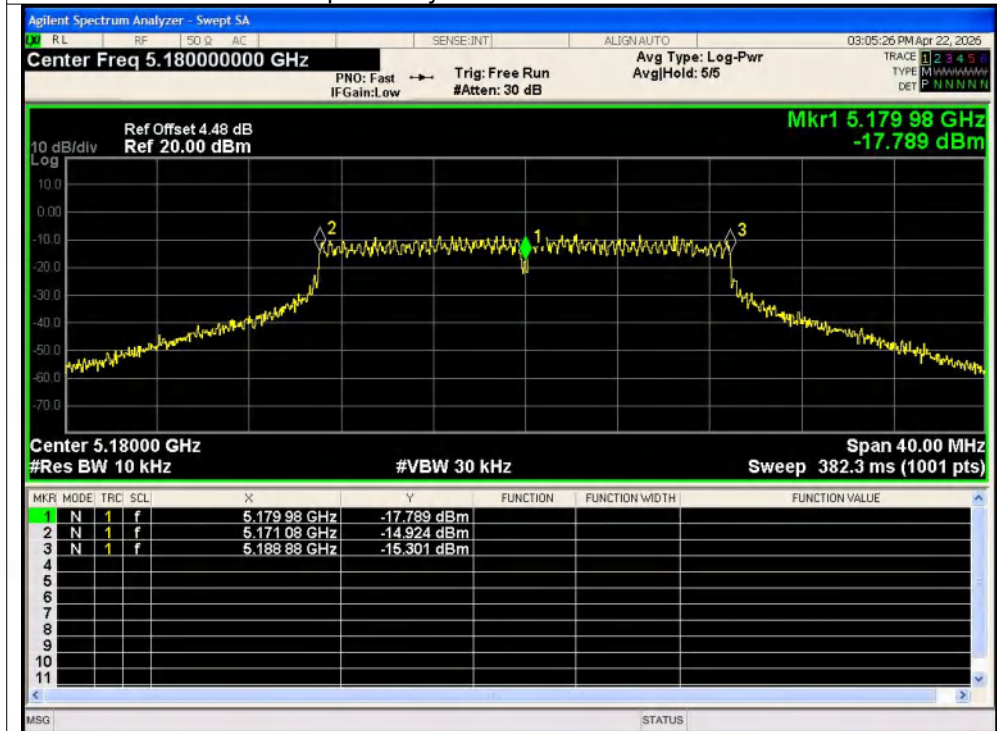


Freq. Stability -20C 120V n20 5180MHz

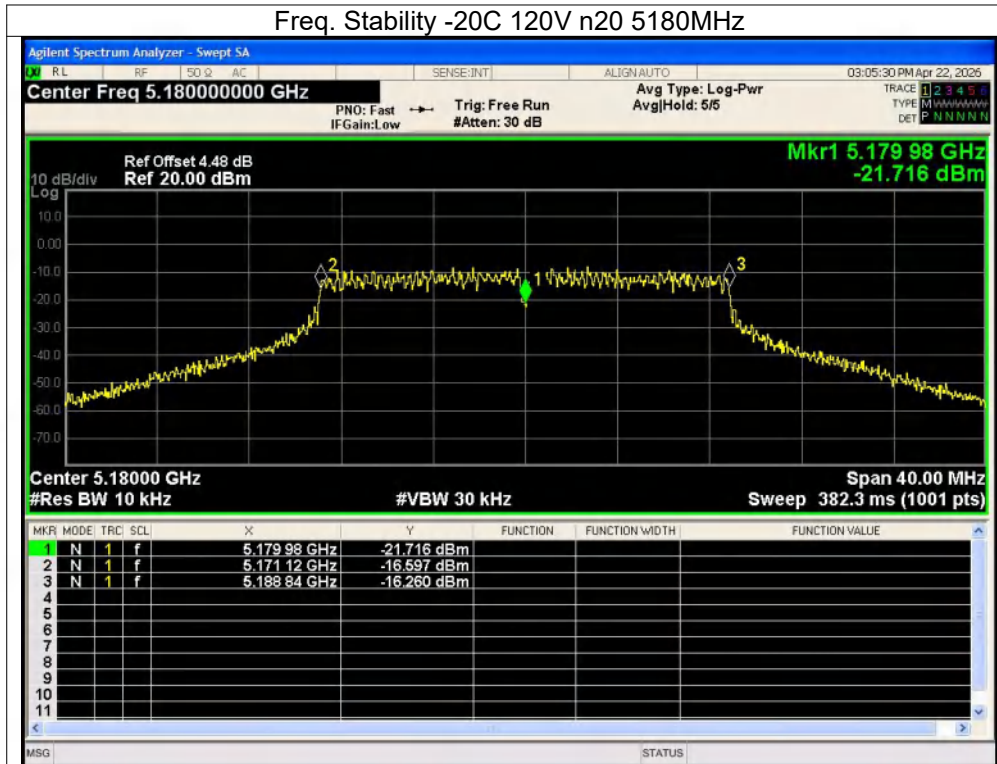


Freq. Stability -10C 120V n20 5180MHz

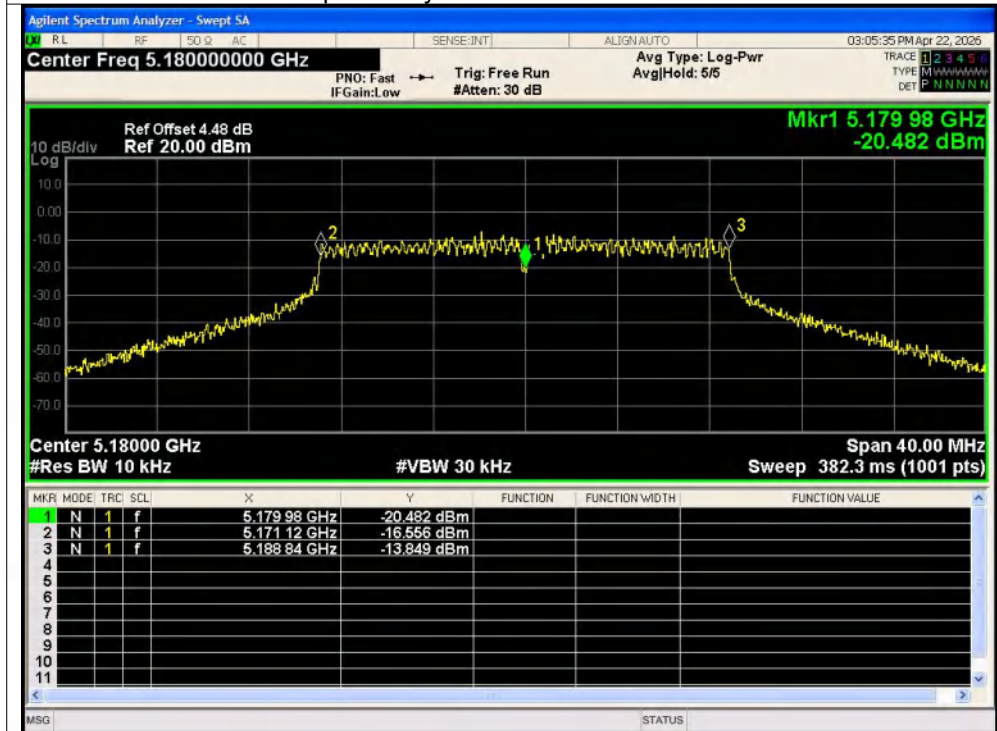


Freq. Stability 0C 120V n20 5180MHz

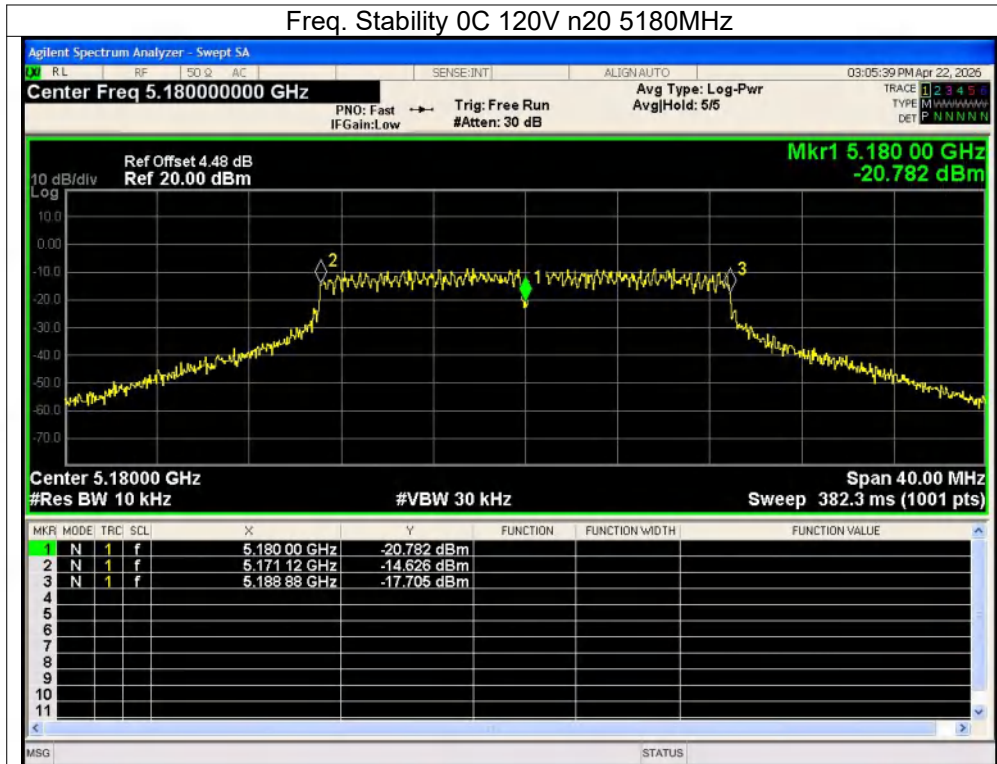


Freq. Stability 10C 120V n20 5180MHz

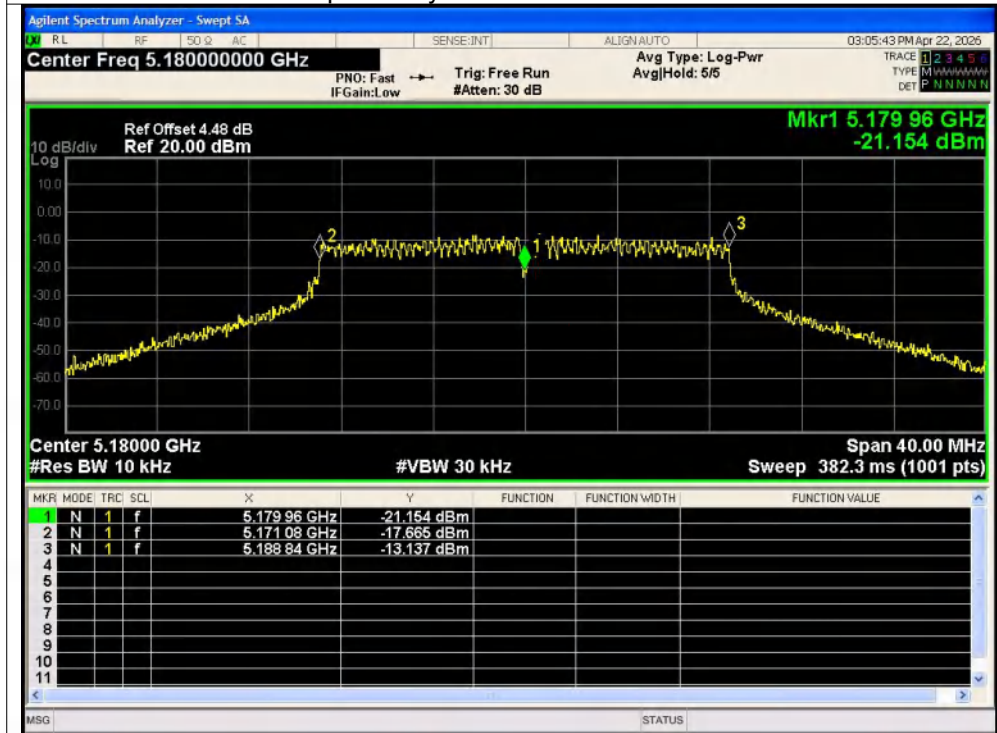


Freq. Stability 30C 120V n20 5180MHz

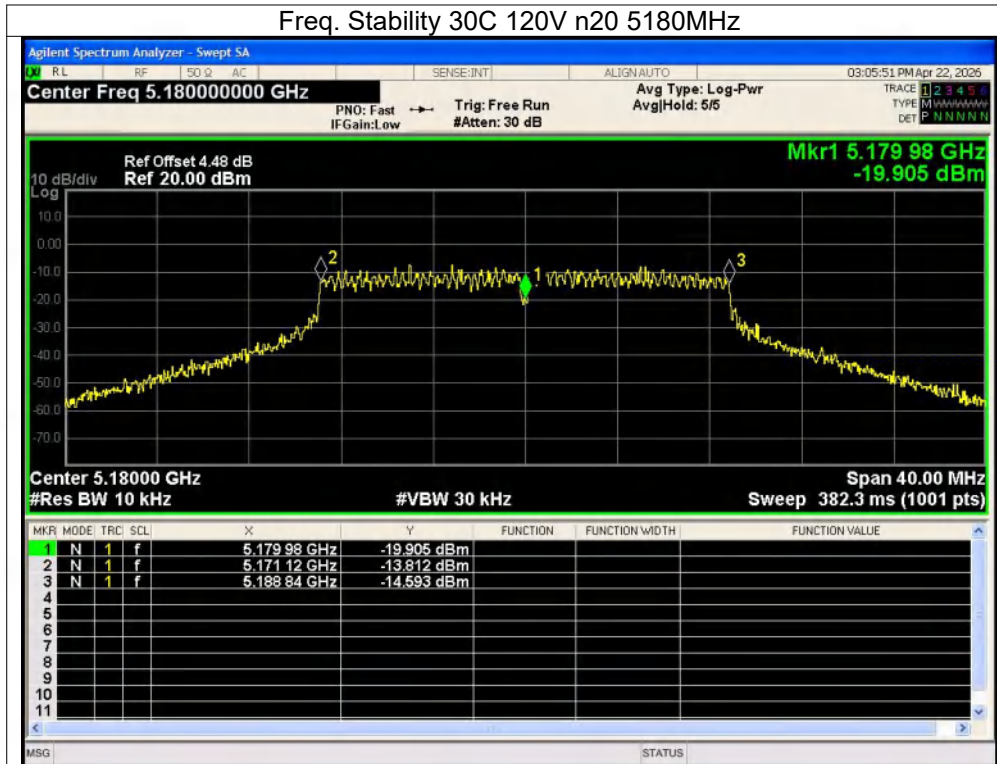


Freq. Stability 40C 120V n20 5180MHz

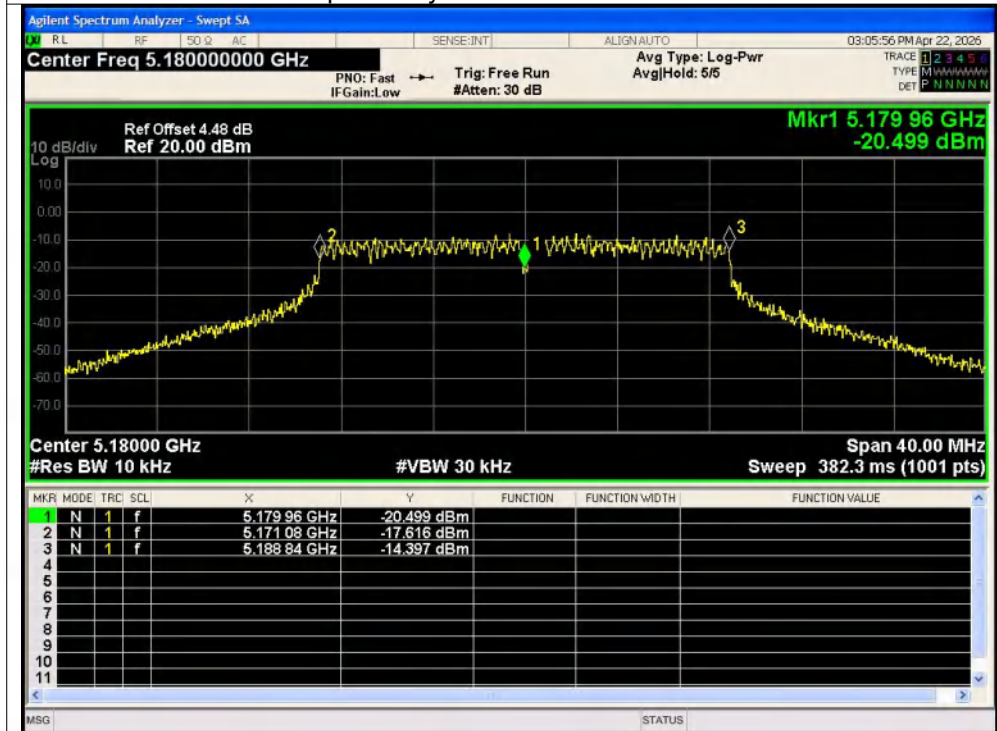


Freq. Stability 50C 120V n20 5180MHz

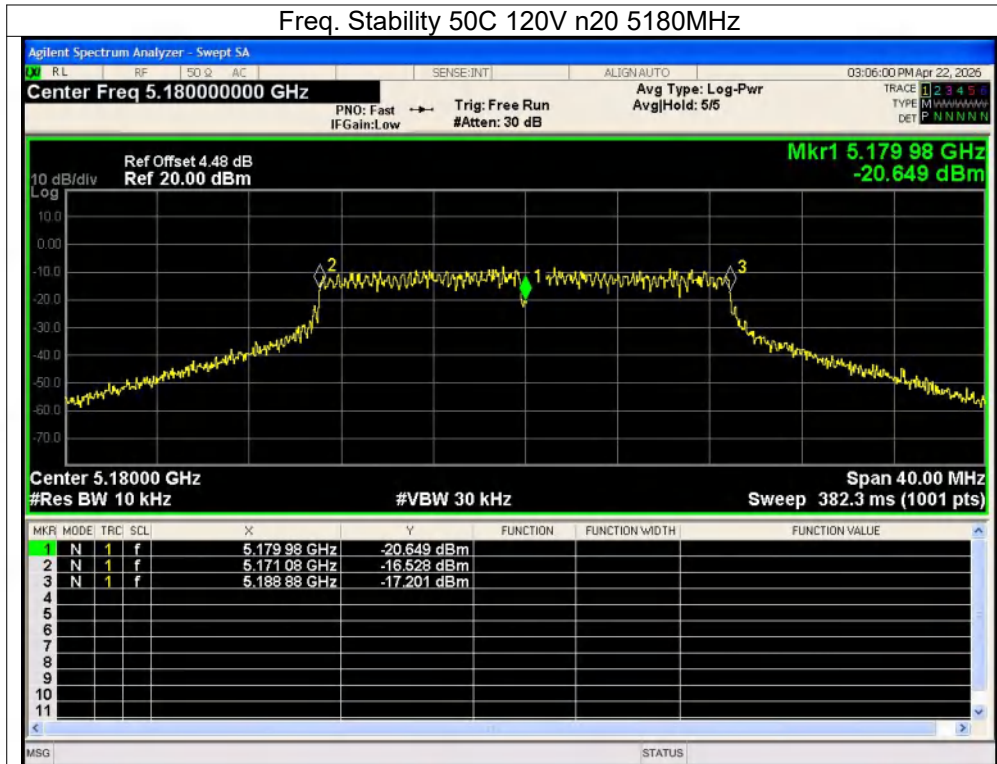

Freq. Stability 20C 102V n20 5200MHz

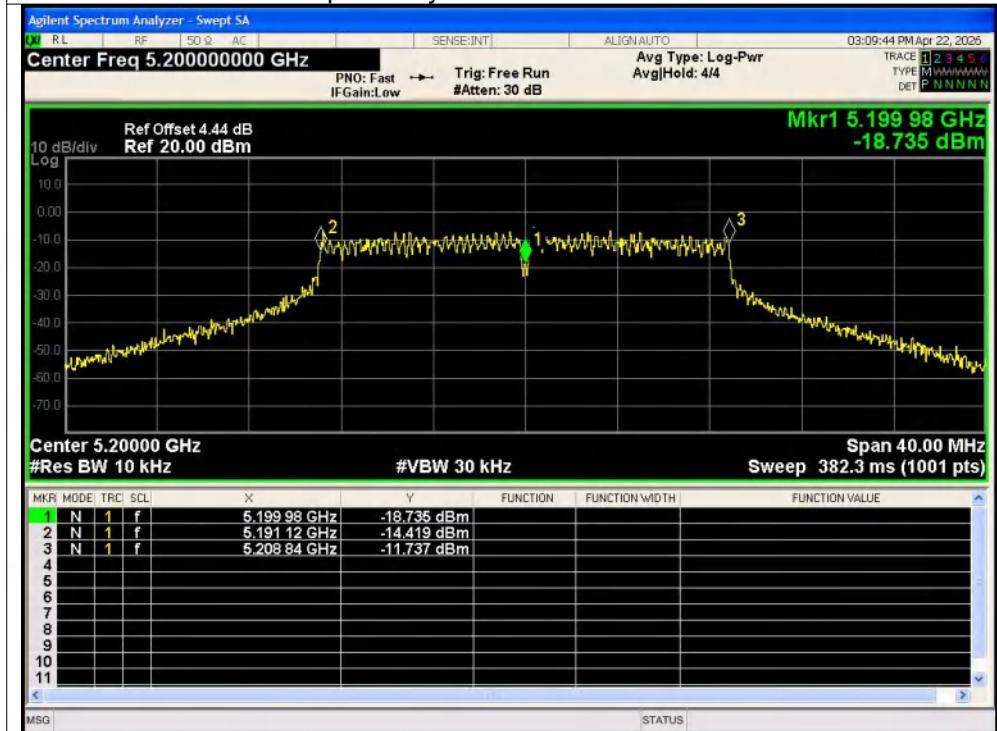

Freq. Stability 20C 120V n20 5200MHz

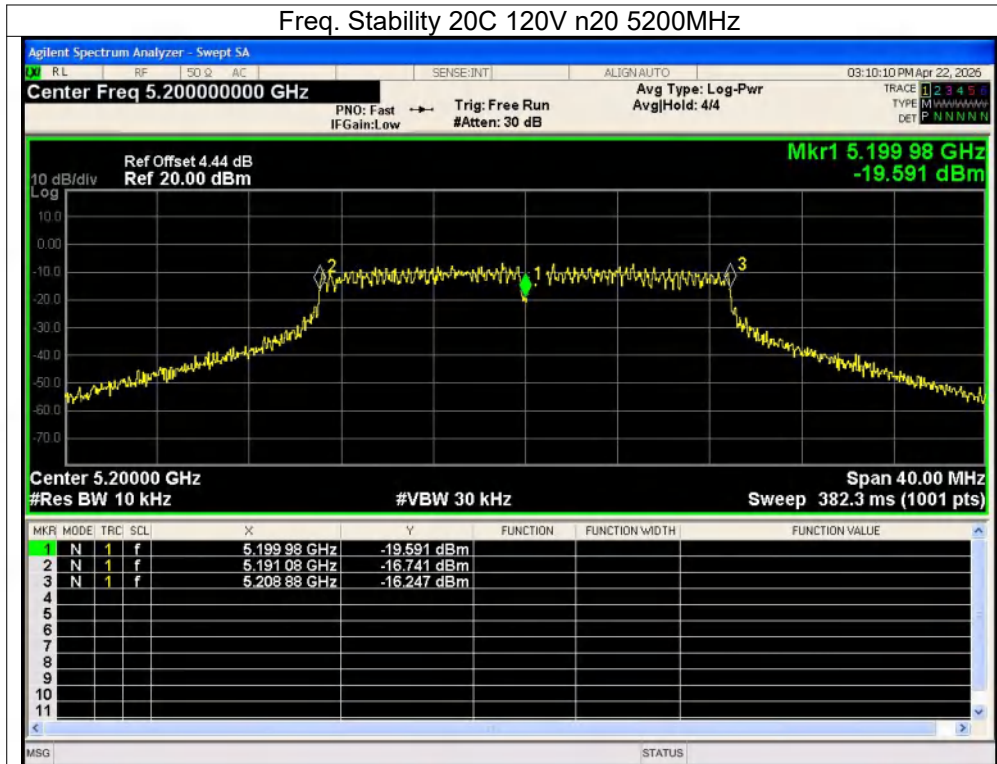

Freq. Stability 20C 138V n20 5200MHz

