Band12_1.4MHz_QPSK_LCH_699.7MHz_RB_1_0_NTNV

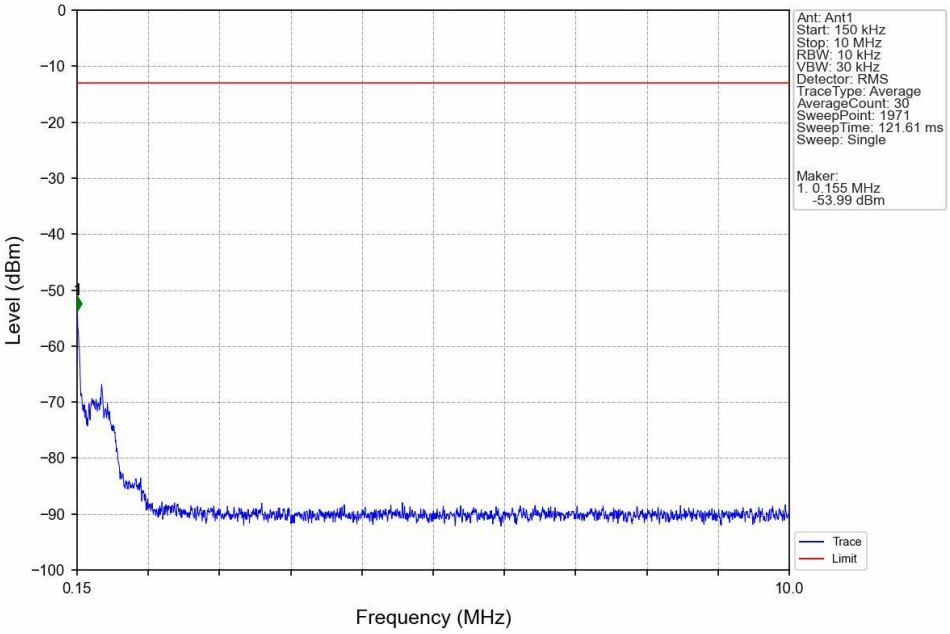


Band12_1.4MHz_QPSK_LCH_699.7MHz_RB_1_0_NTNV

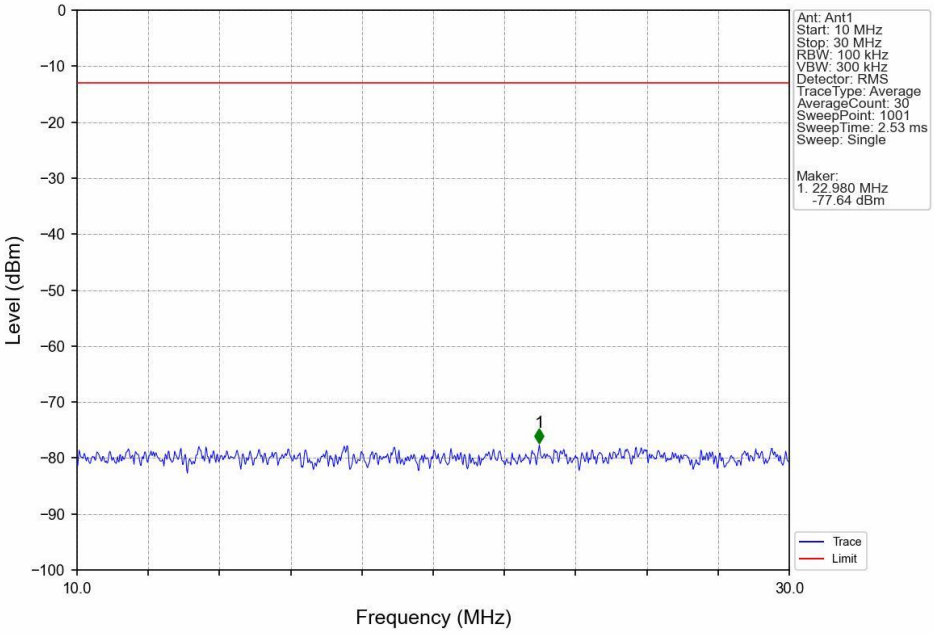

Band12_1.4MHz_QPSK_LCH_699.7MHz_RB_1_0_NTNV

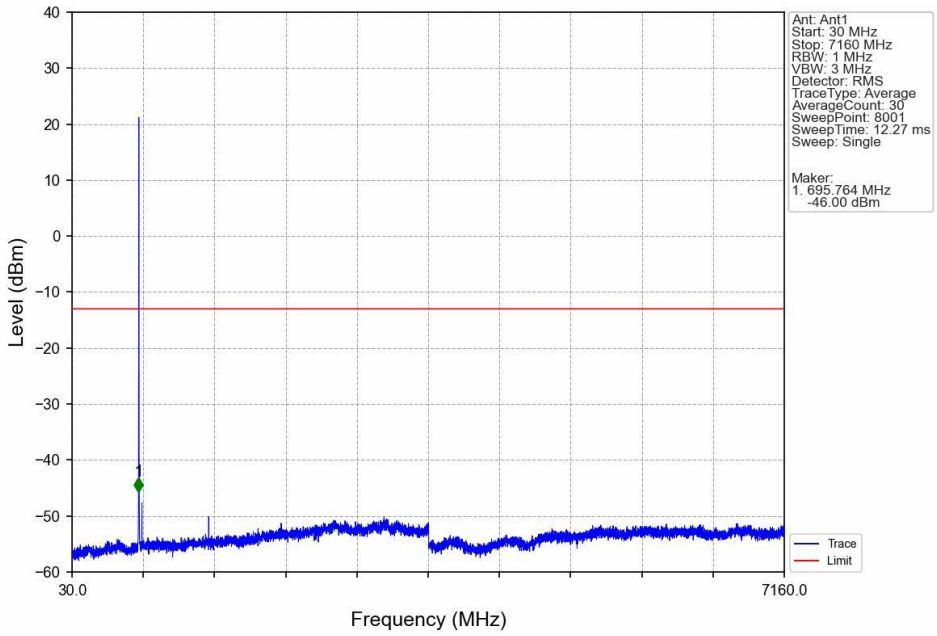


Band12_1.4MHz_QPSK_LCH_699.7MHz_RB_6_0_NTNV

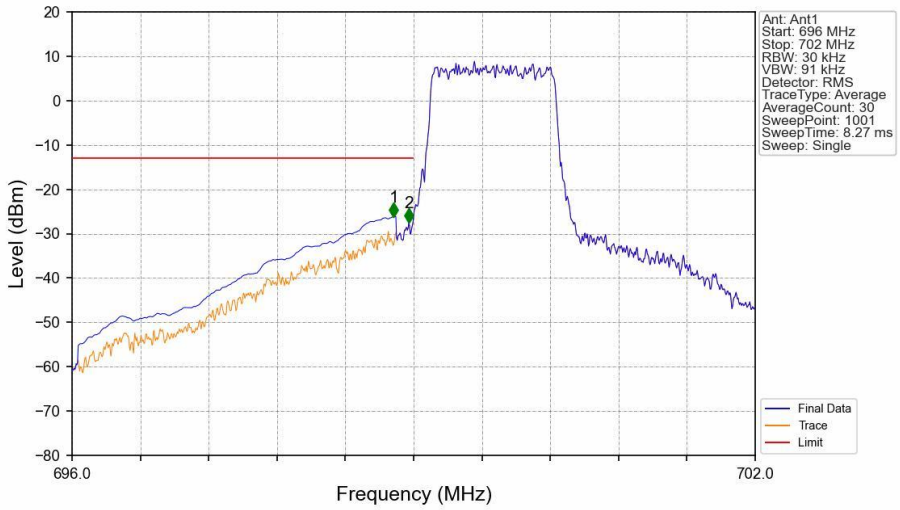


| Start (MHz) | Stop (MHz) | RBW (MHz) | Method | Marker No. | Freq (MHz) | Level (dBm) | Limit (dBm) | Result |
|---|---|---|---|---|---|---|---|---|
| 696 | 698.9 | 0.1 | CHP | 1 | 698.826 | -26.17 | -13 | Pass |
| 698.9 | 699 | 0.03 | / | 2 | 698.958 | -27.55 | -13 | Pass |
| 699 | 702 | 0.03 | / | / | / | / | / | / |

Total or partial reproduction of this document without permission of the Laboratory is not allowed.

BTF Testing Lab (Shenzhen) Co., Ltd.
101/201/301, Building 1, Block 2, Tantou Industrial Park,Tantou Community, Songgang Subdistrict, Bao'an District, Shenzhen, China
Email: info@btf-lab.com Tel: +86-755-23146130 http://www.btf-lab.com

Band12_1.4MHz_QPSK_MCH_707.5MHz_RB_1_0_NTNV

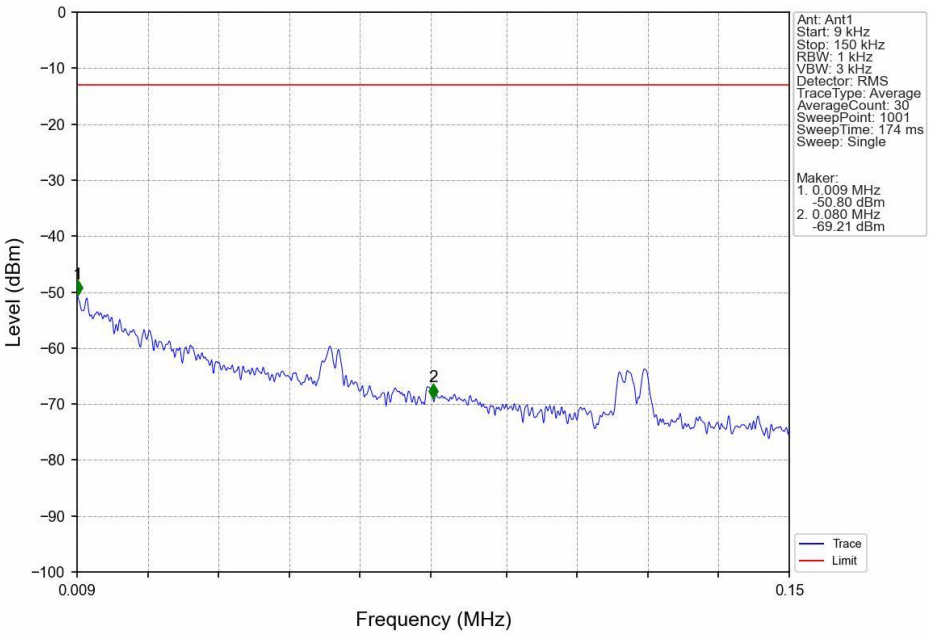


Band12_1.4MHz_QPSK_MCH_707.5MHz_RB_1_0_NTNV

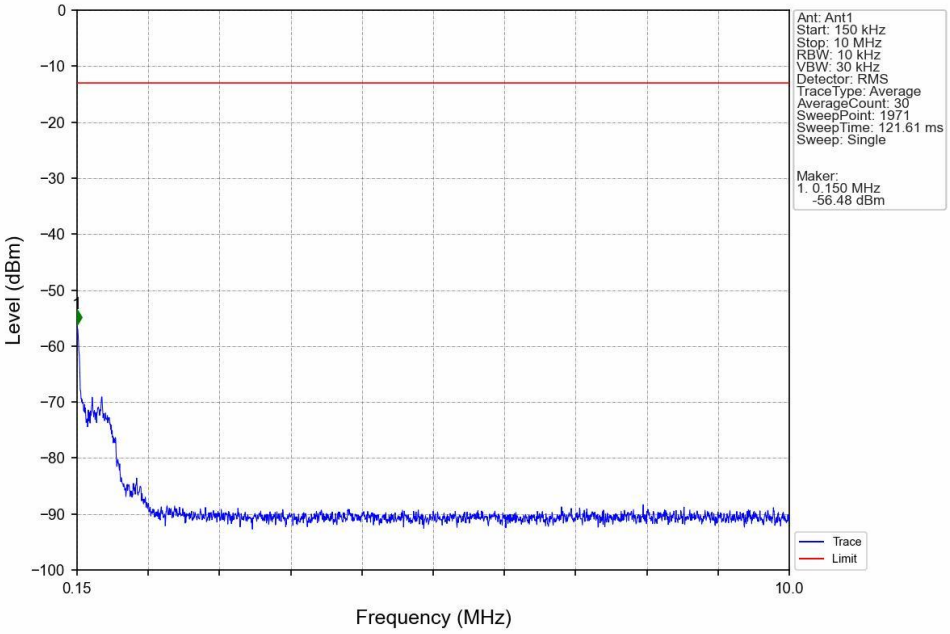

Band12_1.4MHz_QPSK_MCH_707.5MHz_RB_1_0_NTNV

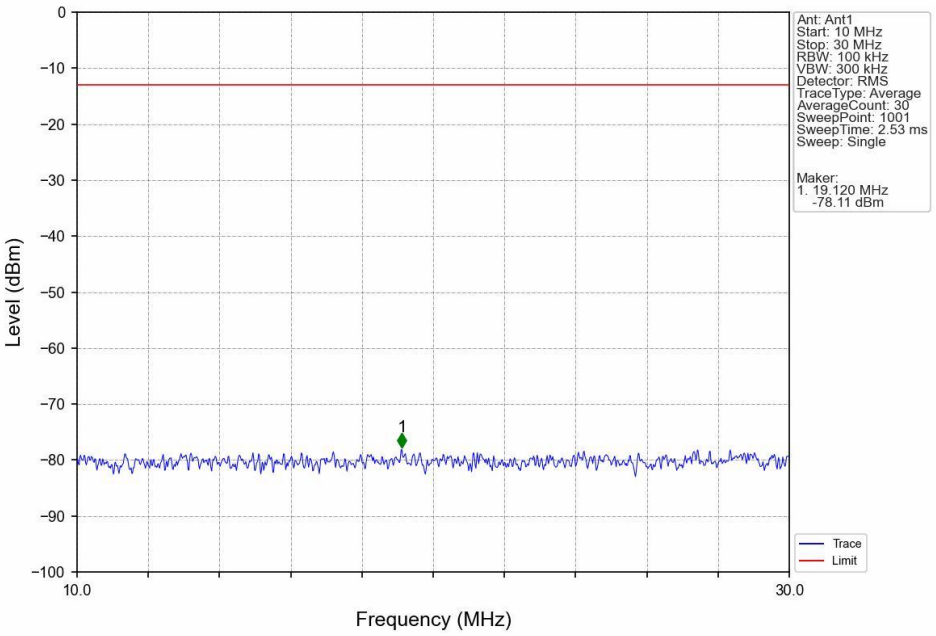


Band12_1.4MHz_QPSK_MCH_707.5MHz_RB_1_0_NTNV

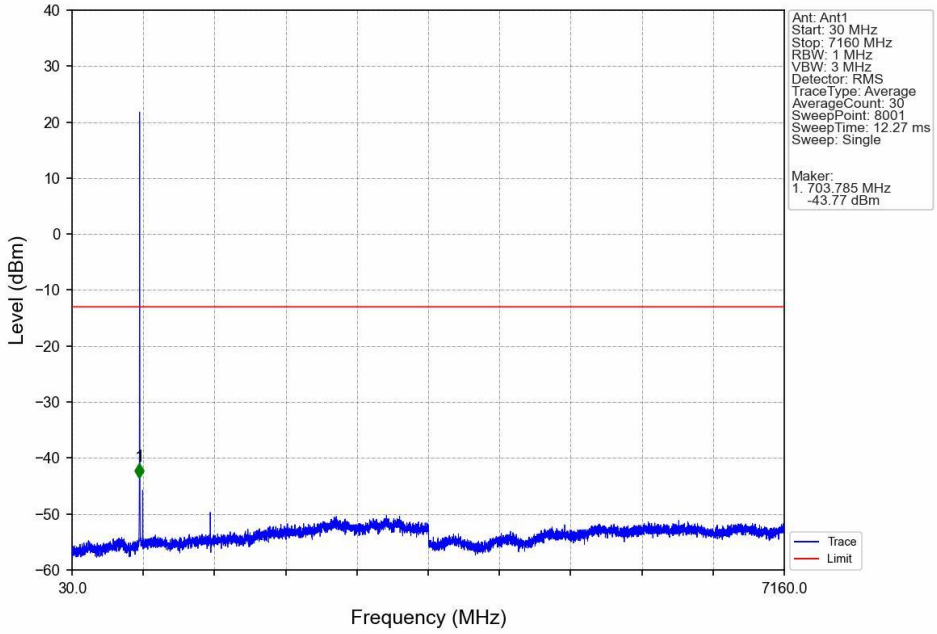

Band12_1.4MHz_QPSK_HCH_715.3MHz_RB_1_0_NTNV

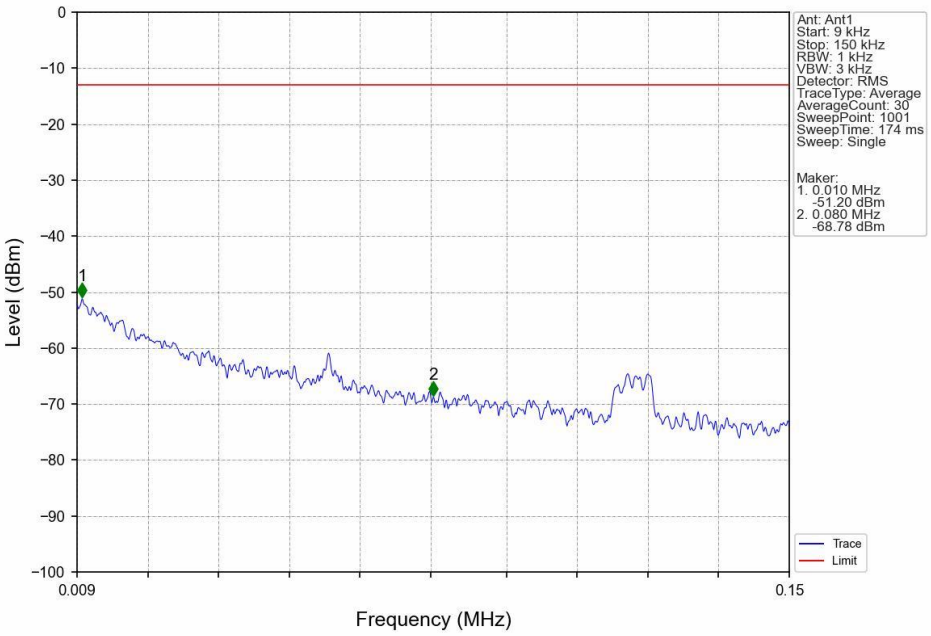


Band12_1.4MHz_QPSK_HCH_715.3MHz_RB_1_0_NTNV

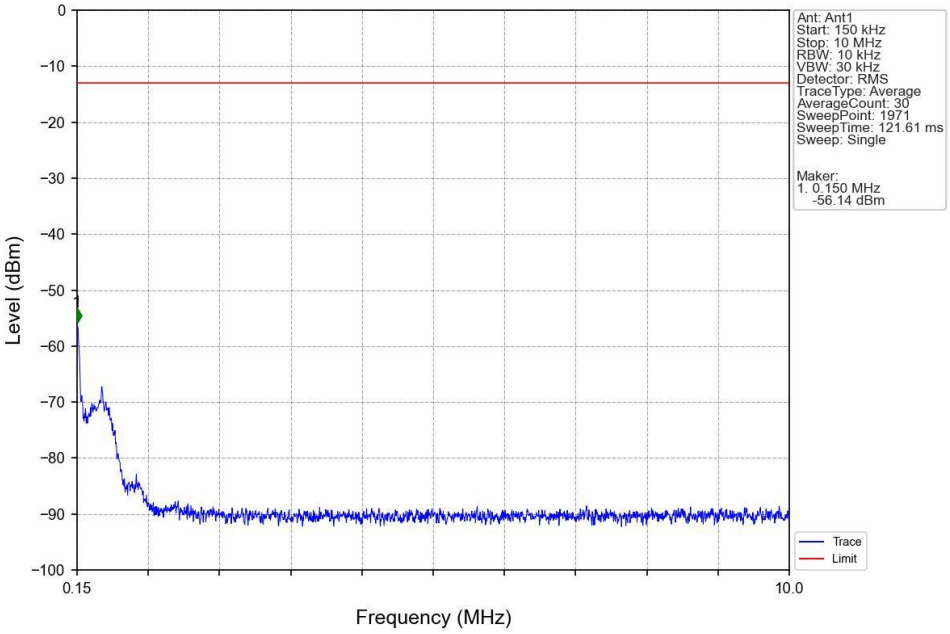

Band12_1.4MHz_QPSK_HCH_715.3MHz_RB_1_0_NTNV

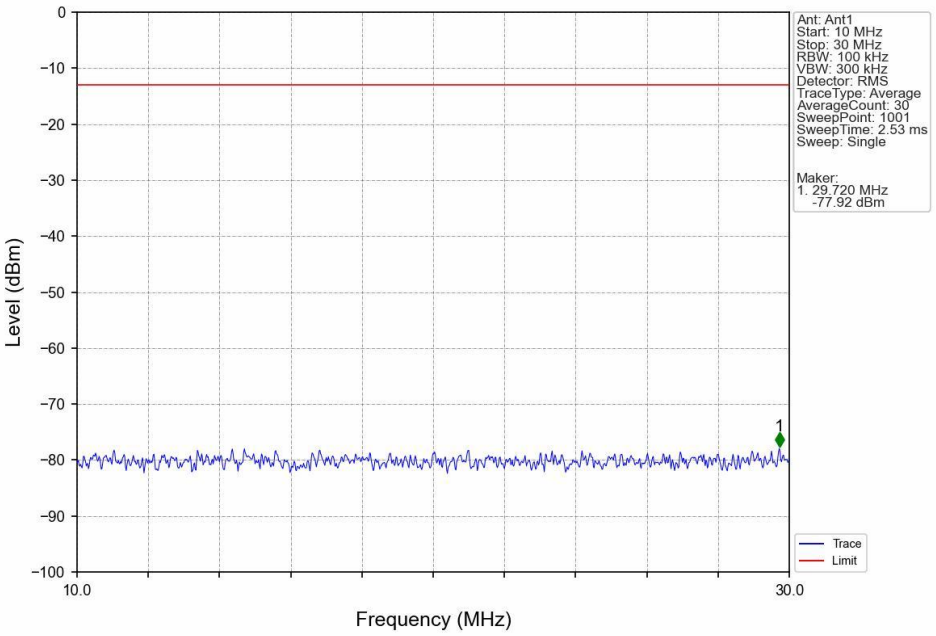


Band12_1.4MHz_QPSK_HCH_715.3MHz_RB_1_0_NTNV

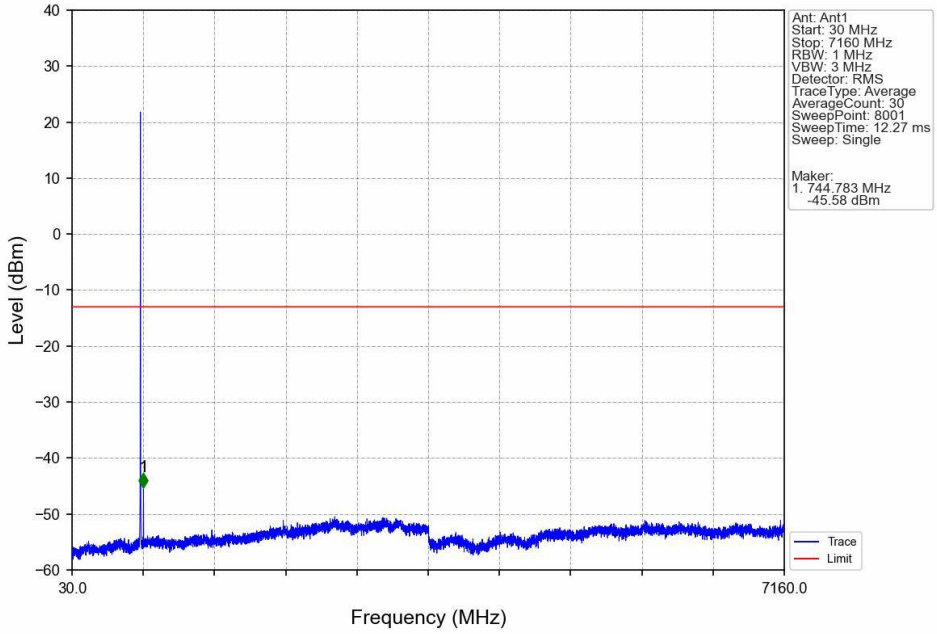

Band12_1.4MHz_QPSK_HCH_715.3MHz_RB_1_5_NTNV

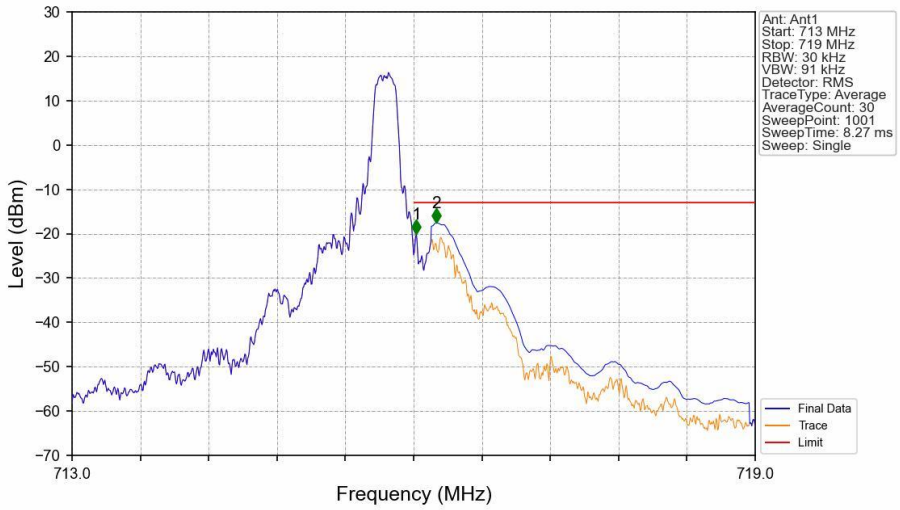


| Start (MHz) | Stop (MHz) | RBW (MHz) | Method | Marker No. | Freq (MHz) | Level (dBm) | Limit (dBm) | Result |
|---|---|---|---|---|---|---|---|---|
| 713 | 716 | 0.03 | / | / | / | / | / | / |
| 716 | 716.1 | 0.03 | / | 1 | 716.024 | -19.98 | -13 | Pass |
| 716.1 | 719 | 0.1 | CHP | 2 | 716.198 | -17.57 | -13 | Pass |

Band12_1.4MHz_QPSK_HCH_715.3MHz_RB_6_0_NTNV

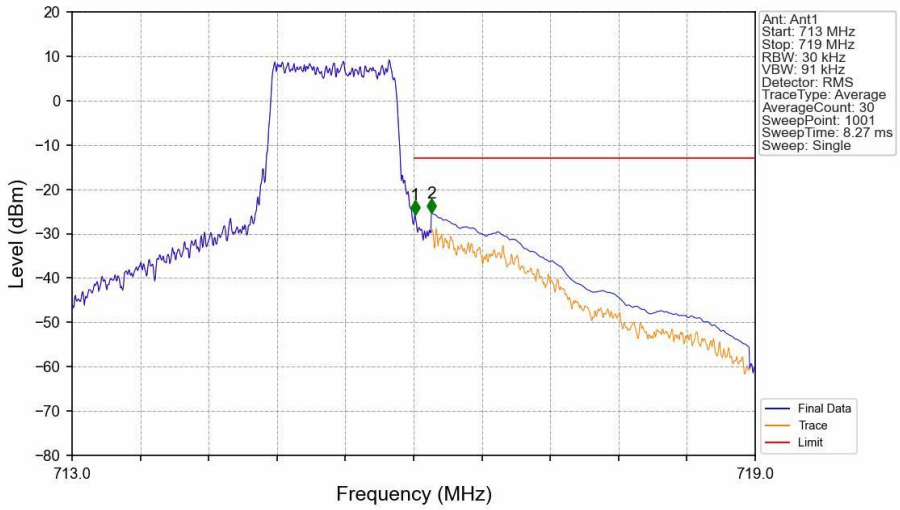


| Start (MHz) | Stop (MHz) | RBW (MHz) | Method | Marker No. | Freq (MHz) | Level (dBm) | Limit (dBm) | Result |
|---|---|---|---|---|---|---|---|---|
| 713 | 716 | 0.03 | / | / | / | / | / | / |
| 716 | 716.1 | 0.03 | / | 1 | 716.012 | -25.66 | -13 | Pass |
| 716.1 | 719 | 0.1 | CHP | 2 | 716.156 | -25.35 | -13 | Pass |

Total or partial reproduction of this document without permission of the Laboratory is not allowed.

BTF Testing Lab (Shenzhen) Co., Ltd.
101/201/301, Building 1, Block 2, Tantou Industrial Park,Tantou Community, Songgang Subdistrict, Bao'an District, Shenzhen, China
Email: info@btf-lab.com Tel: +86-755-23146130 http://www.btf-lab.com

Band12_1.4MHz_16QAM_LCH_699.7MHz_RB_1_0_NTNV

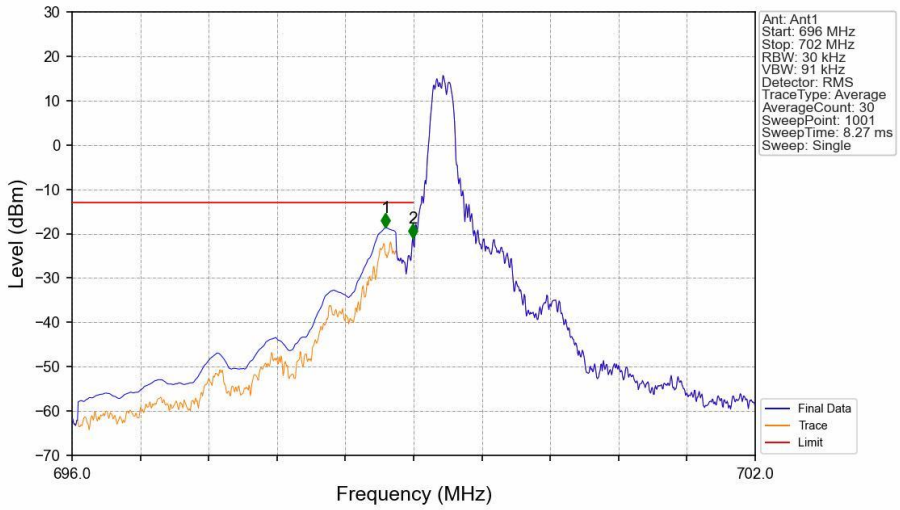


| Start (MHz) | Stop (MHz) | RBW (MHz) | Method | Marker No. | Freq (MHz) | Level (dBm) | Limit (dBm) | Result |
|---|---|---|---|---|---|---|---|---|
| 696 | 698.9 | 0.1 | CHP | 1 | 698.754 | -18.65 | -13 | Pass |
| 698.9 | 699 | 0.03 | / | 2 | 698.994 | -20.96 | -13 | Pass |
| 699 | 702 | 0.03 | / | / | / | / | / | / |

Band12_1.4MHz_16QAM_LCH_699.7MHz_RB_1_0_NTNV

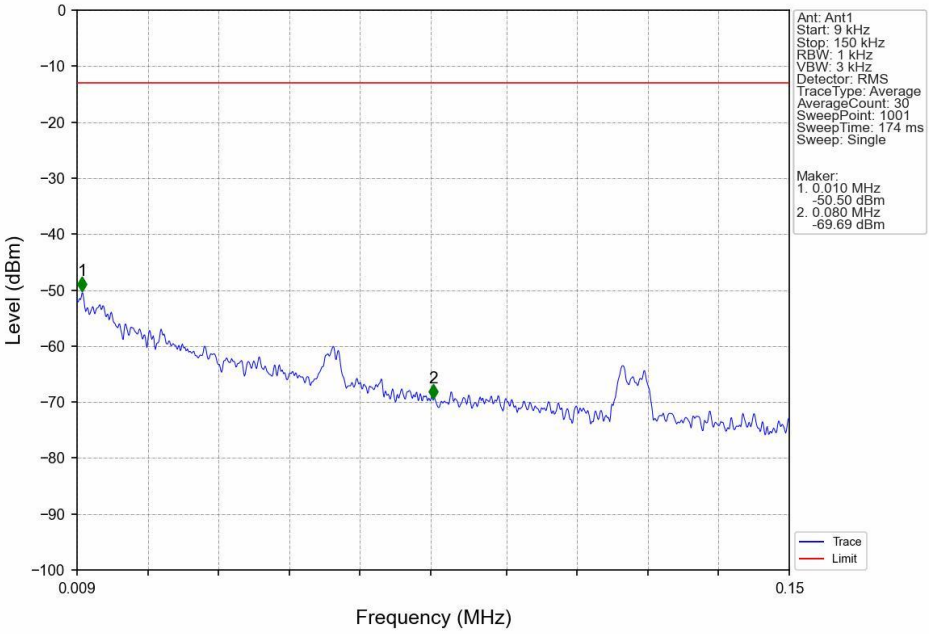

Band12_1.4MHz_16QAM_LCH_699.7MHz_RB_1_0_NTNV

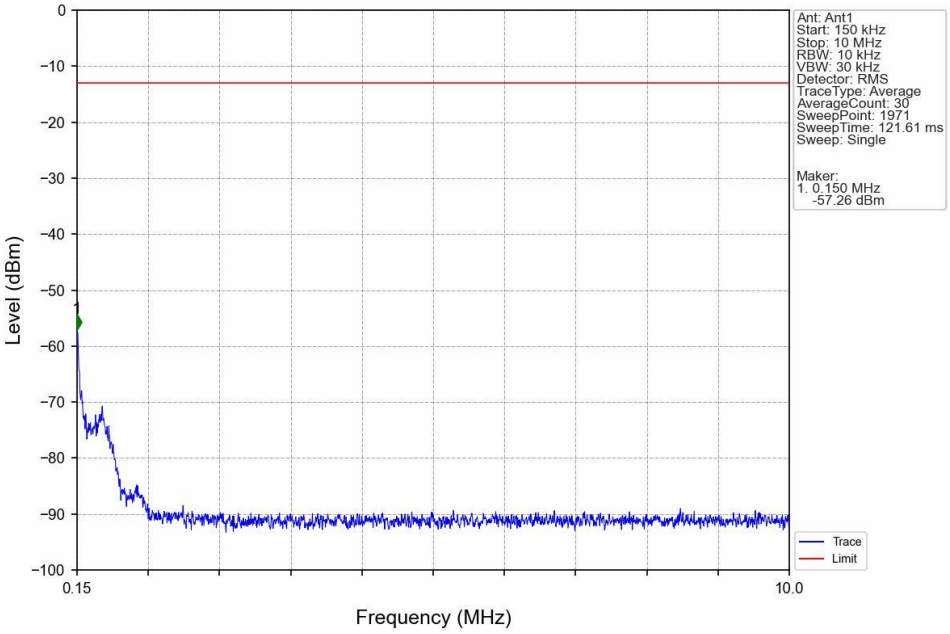


Band12_1.4MHz_16QAM_LCH_699.7MHz_RB_1_0_NTNV

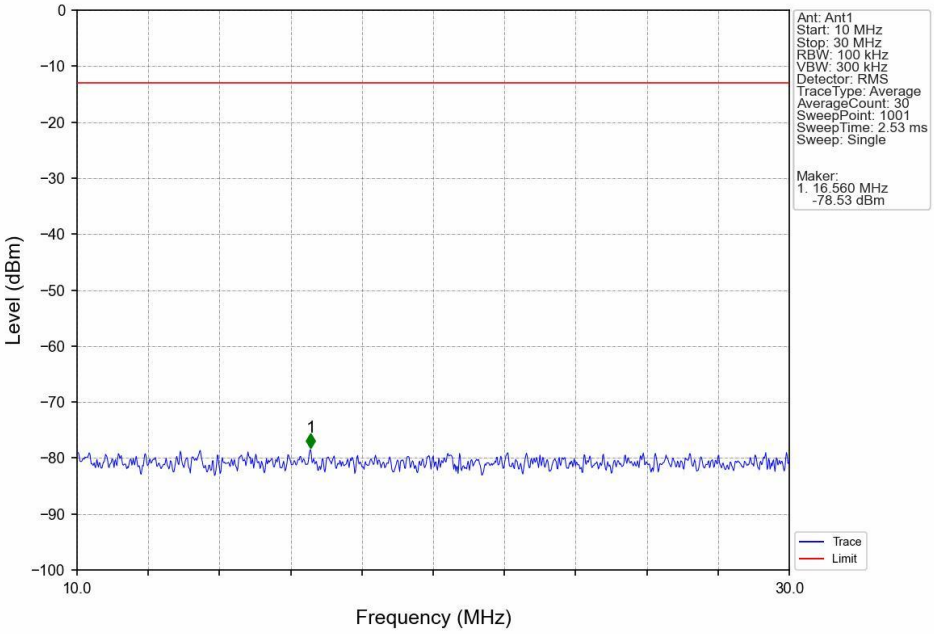

Band12_1.4MHz_16QAM_LCH_699.7MHz_RB_1_0_NTNV

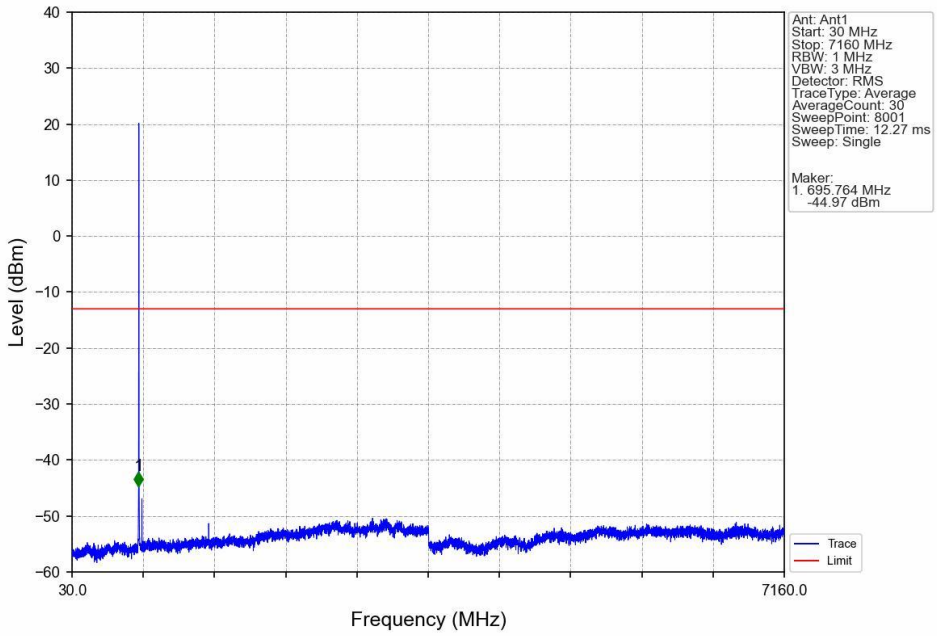


Band12_1.4MHz_16QAM_LCH_699.7MHz_RB_6_0_NTNV

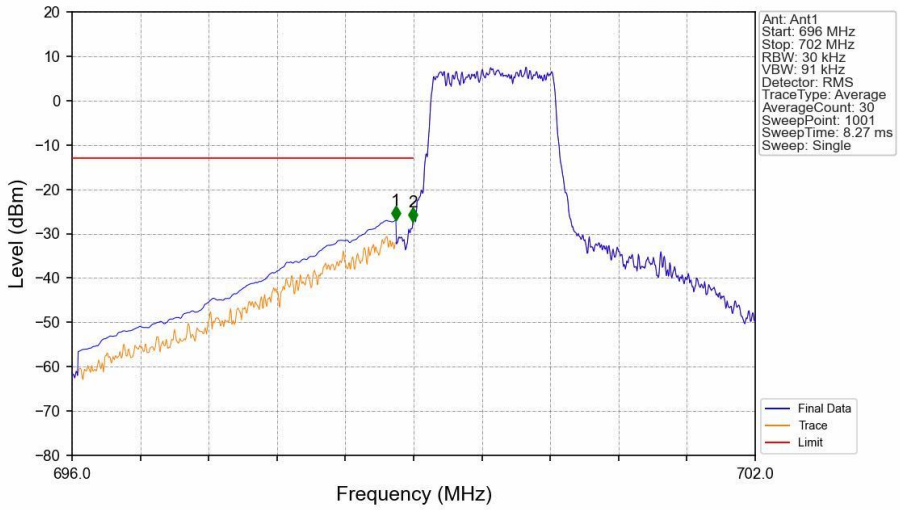


| Start (MHz) | Stop (MHz) | RBW (MHz) | Method | Marker No. | Freq (MHz) | Level (dBm) | Limit (dBm) | Result |
|---|---|---|---|---|---|---|---|---|
| 696 | 698.9 | 0.1 | CHP | 1 | 698.844 | -26.99 | -13 | Pass |
| 698.9 | 699 | 0.03 | / | 2 | 698.994 | -27.32 | -13 | Pass |
| 699 | 702 | 0.03 | / | / | / | / | / | / |

Total or partial reproduction of this document without permission of the Laboratory is not allowed.

BTF Testing Lab (Shenzhen) Co., Ltd.
101/201/301, Building 1, Block 2, Tantou Industrial Park,Tantou Community, Songgang Subdistrict, Bao'an District, Shenzhen, China
Email: info@btf-lab.com Tel: +86-755-23146130 http://www.btf-lab.com

Band12_1.4MHz_16QAM_MCH_707.5MHz_RB_1_0_NTNV

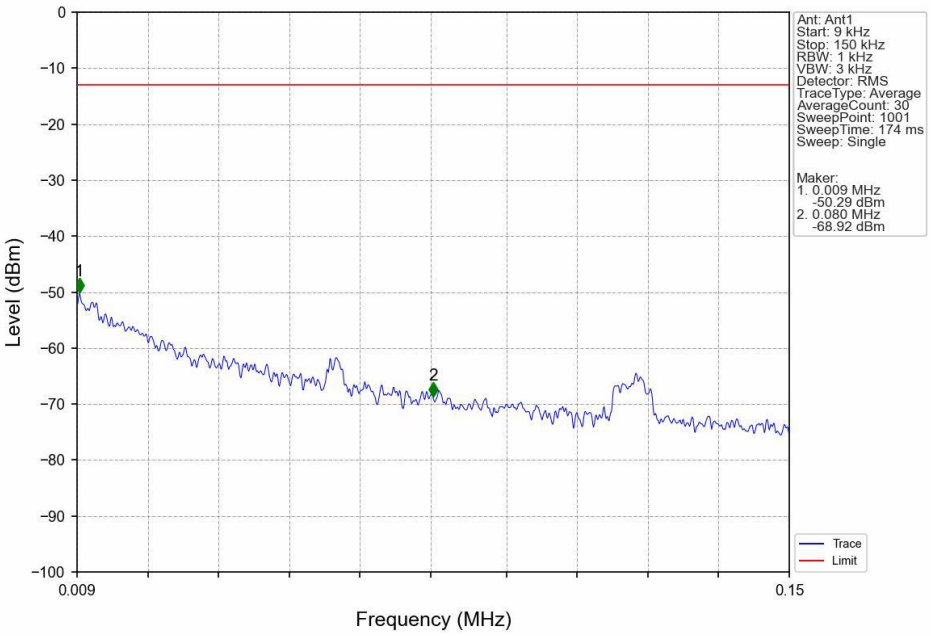


Band12_1.4MHz_16QAM_MCH_707.5MHz_RB_1_0_NTNV

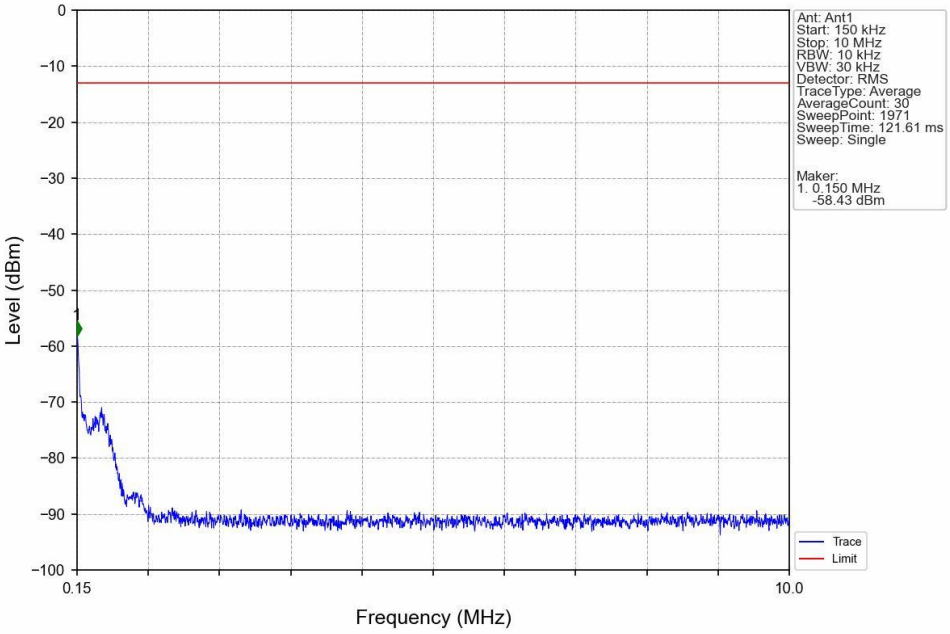

Band12_1.4MHz_16QAM_MCH_707.5MHz_RB_1_0_NTNV

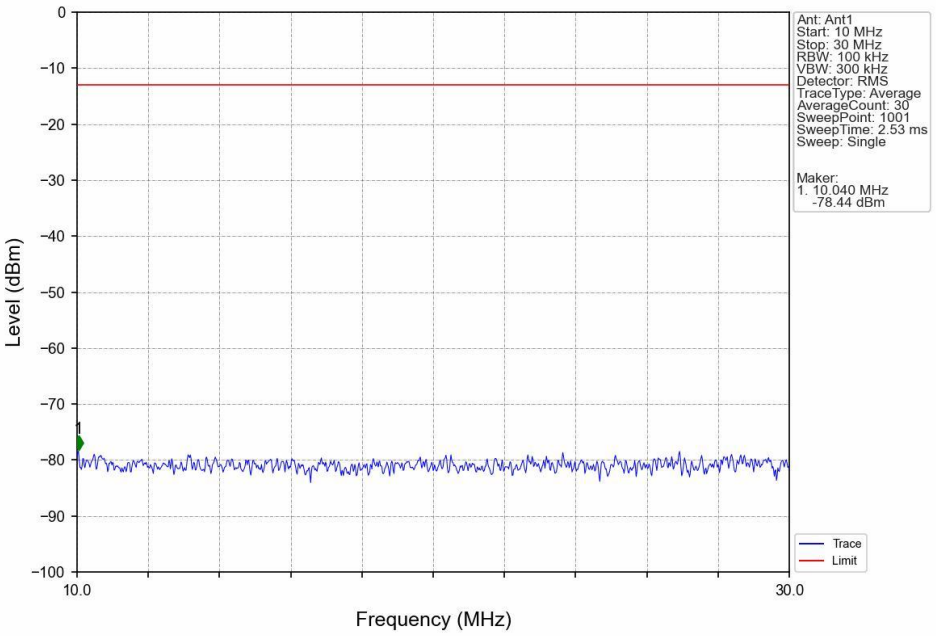


Band12_1.4MHz_16QAM_MCH_707.5MHz_RB_1_0_NTNV

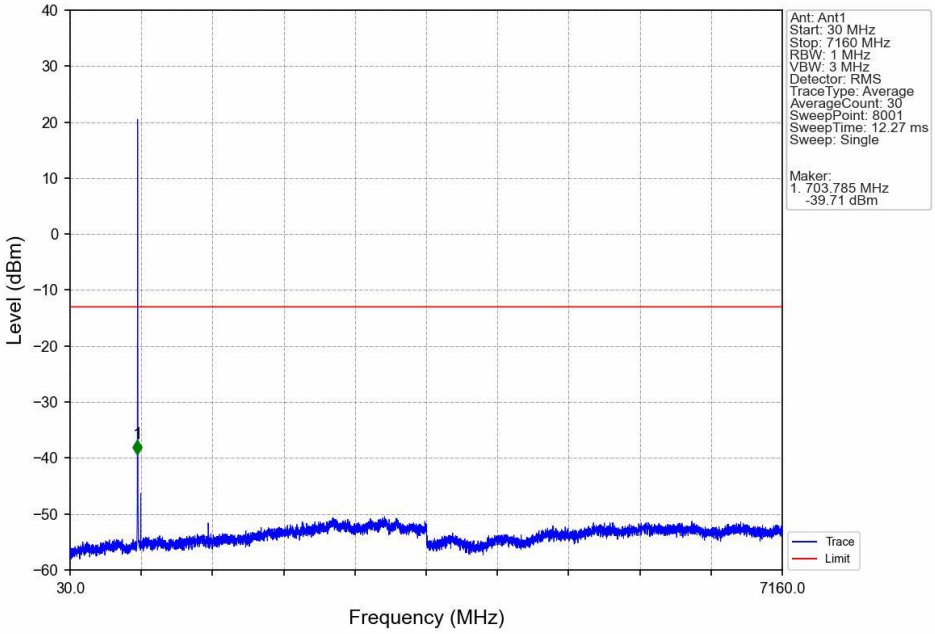

Band12_1.4MHz_16QAM_HCH_715.3MHz_RB_1_0_NTNV

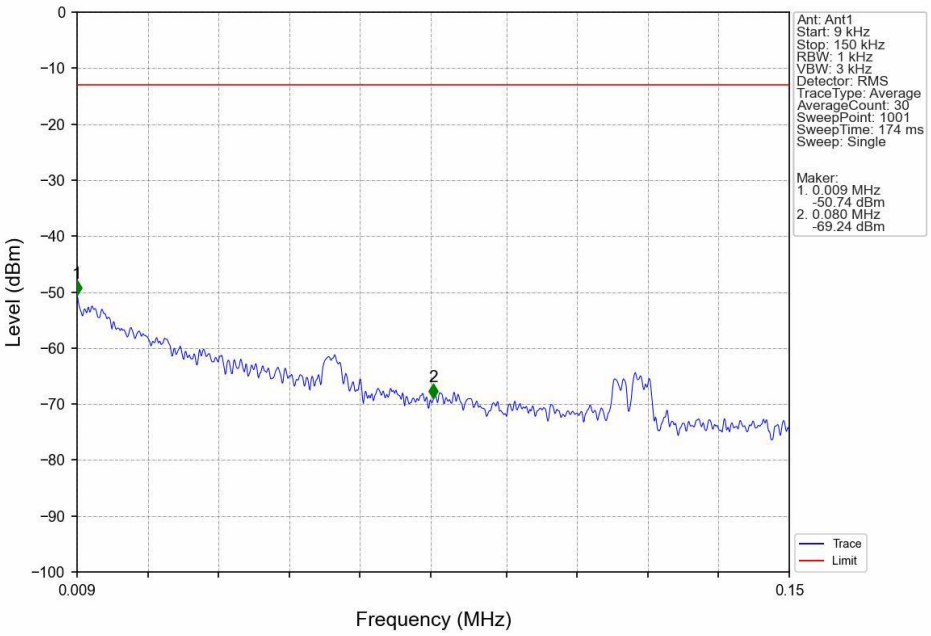


Band12_1.4MHz_16QAM_HCH_715.3MHz_RB_1_0_NTNV

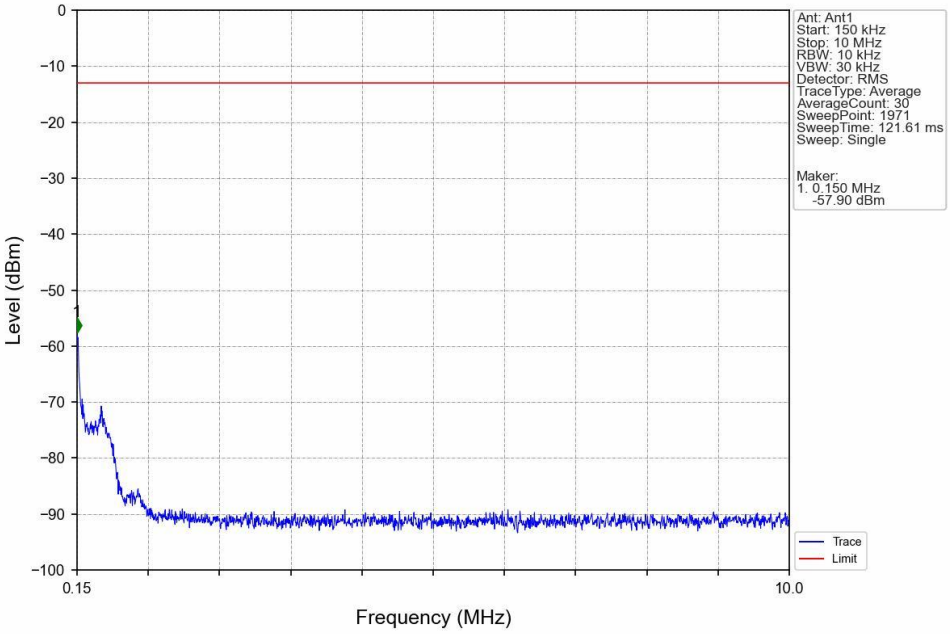

Band12_1.4MHz_16QAM_HCH_715.3MHz_RB_1_0_NTNV

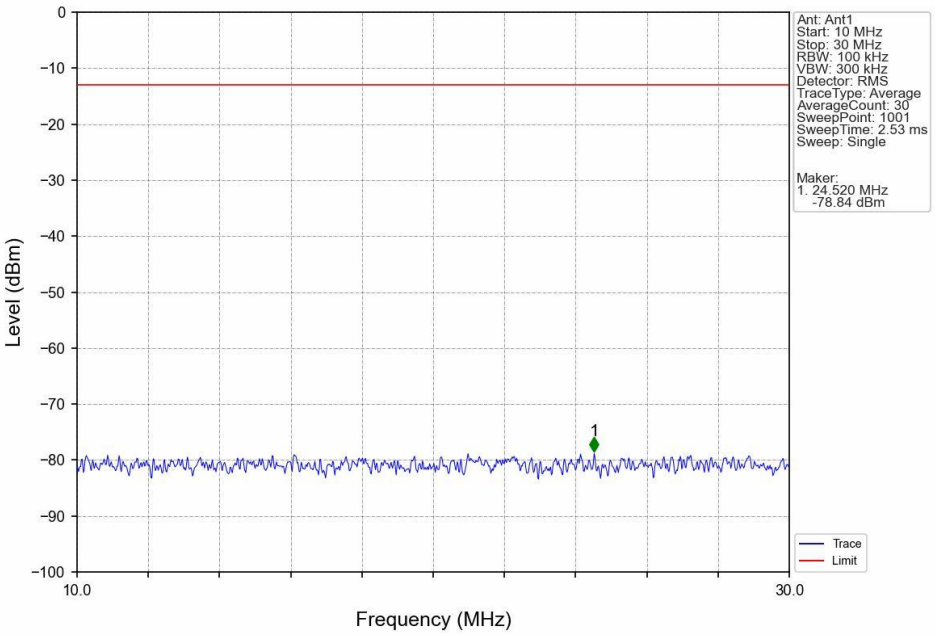


Band12_1.4MHz_16QAM_HCH_715.3MHz_RB_1_0_NTNV

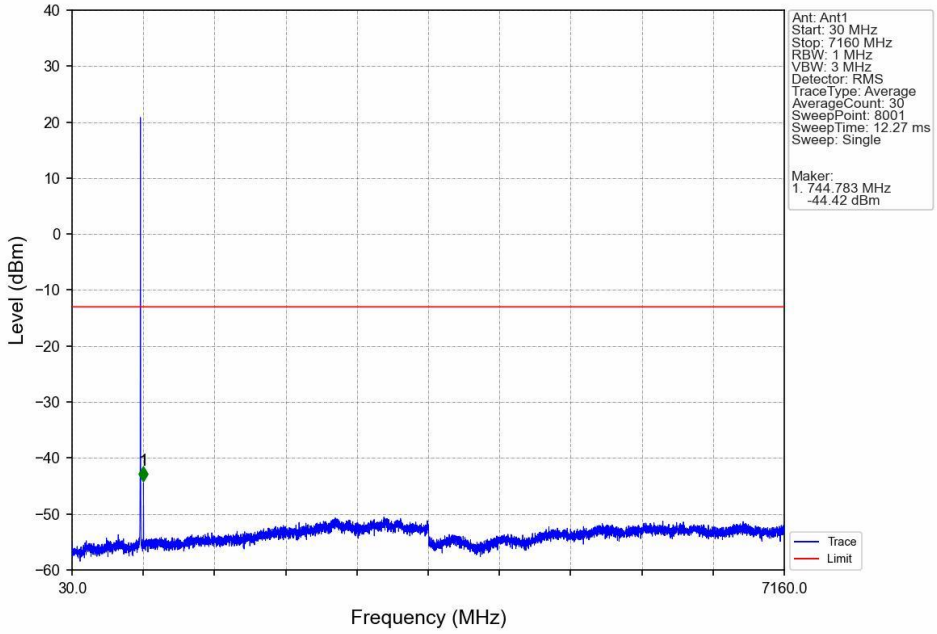

Band12_1.4MHz_16QAM_HCH_715.3MHz_RB_1_5_NTNV

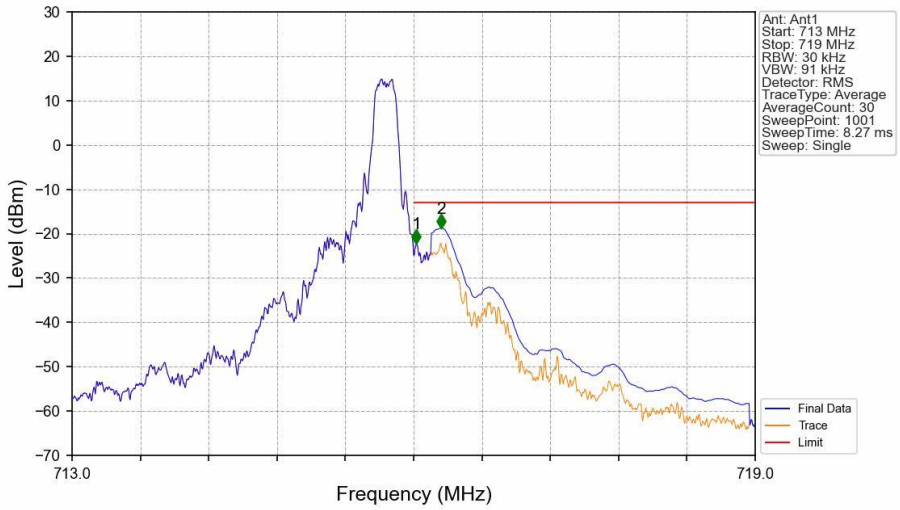


| Start (MHz) | Stop (MHz) | RBW (MHz) | Method | Marker No. | Freq (MHz) | Level (dBm) | Limit (dBm) | Result |
|---|---|---|---|---|---|---|---|---|
| 713 | 716 | 0.03 | / | / | / | / | / | / |
| 716 | 716.1 | 0.03 | / | 1 | 716.024 | -22.22 | -13 | Pass |
| 716.1 | 719 | 0.1 | CHP | 2 | 716.240 | -18.72 | -13 | Pass |

Band12_1.4MHz_16QAM_HCH_715.3MHz_RB_6_0_NTNV

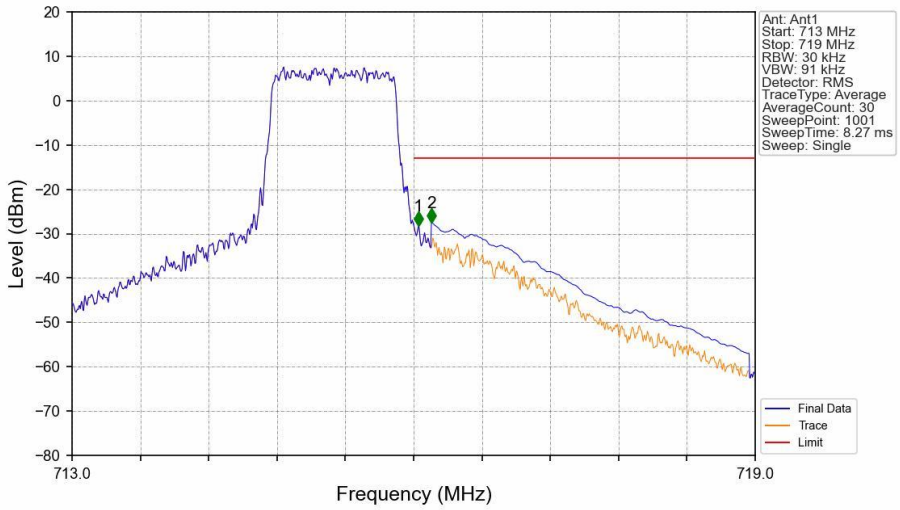


| Start (MHz) | Stop (MHz) | RBW (MHz) | Method | Marker No. | Freq (MHz) | Level (dBm) | Limit (dBm) | Result |
|---|---|---|---|---|---|---|---|---|
| 713 | 716 | 0.03 | / | / | / | / | / | / |
| 716 | 716.1 | 0.03 | / | 1 | 716.042 | -28.26 | -13 | Pass |
| 716.1 | 719 | 0.1 | CHP | 2 | 716.156 | -27.50 | -13 | Pass |

Total or partial reproduction of this document without permission of the Laboratory is not allowed.

BTF Testing Lab (Shenzhen) Co., Ltd.
101/201/301, Building 1, Block 2, Tantou Industrial Park,Tantou Community, Songgang Subdistrict, Bao'an District, Shenzhen, China
Email: info@btf-lab.com Tel: +86-755-23146130 http://www.btf-lab.com

## 6.2.2 B12_3MHz

Band12_3MHz_QPSK_LCH_700.5MHz_RB_1_0_NTNV

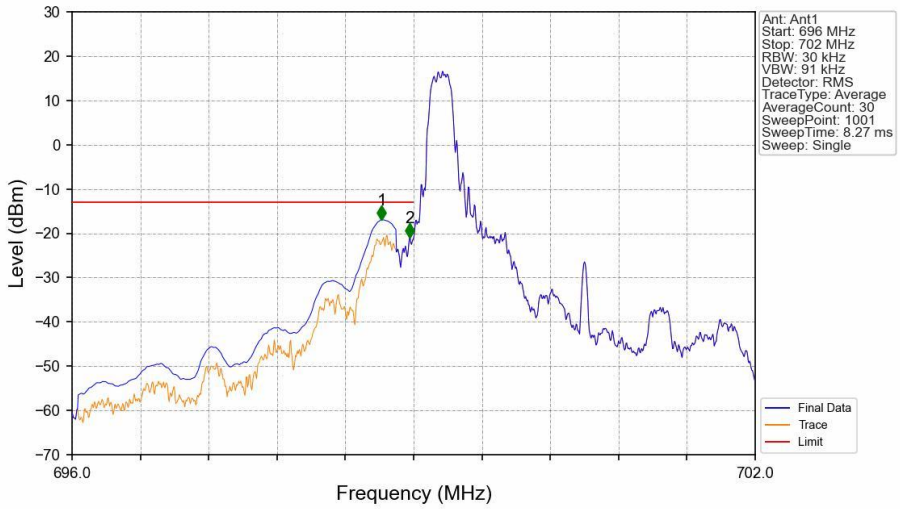


| Start (MHz) | Stop (MHz) | RBW (MHz) | Method | Marker No. | Freq (MHz) | Level (dBm) | Limit (dBm) | Result |
|---|---|---|---|---|---|---|---|---|
| 696 | 698.9 | 0.1 | CHP | 1 | 698.718 | -16.88 | -13 | Pass |
| 698.9 | 699 | 0.03 | / | 2 | 698.964 | -20.95 | -13 | Pass |
| 699 | 702 | 0.03 | / | / | / | / | / | / |

Band12_3MHz_QPSK_LCH_700.5MHz_RB_1_0_NTNV

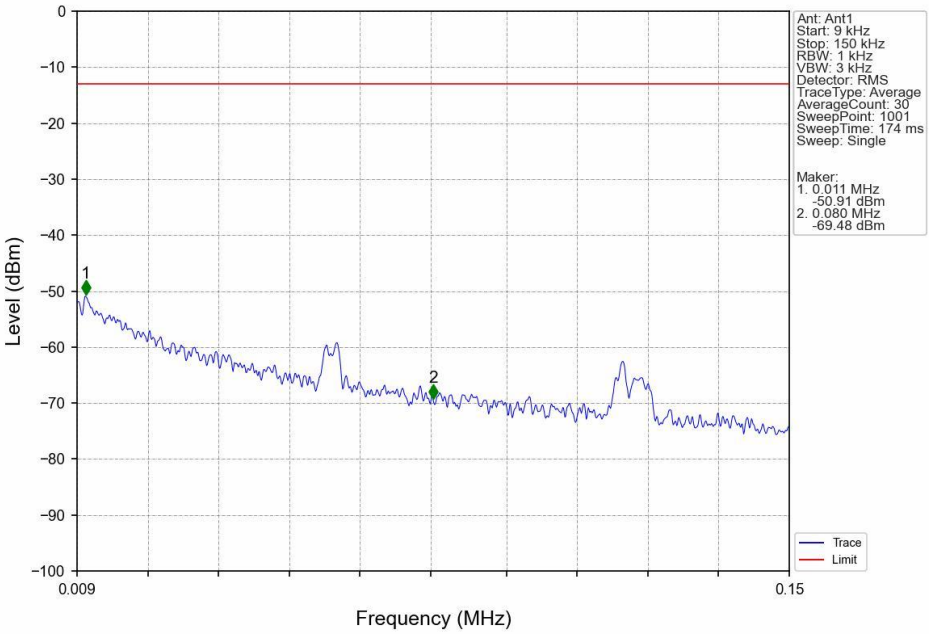

Band12_3MHz_QPSK_LCH_700.5MHz_RB_1_0_NTNV

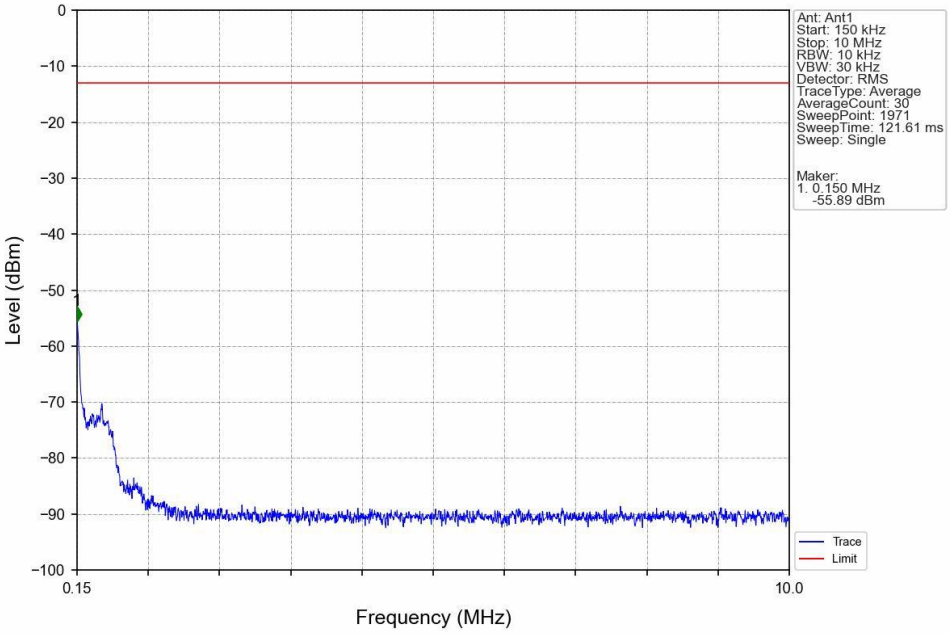


Band12_3MHz_QPSK_LCH_700.5MHz_RB_1_0_NTNV

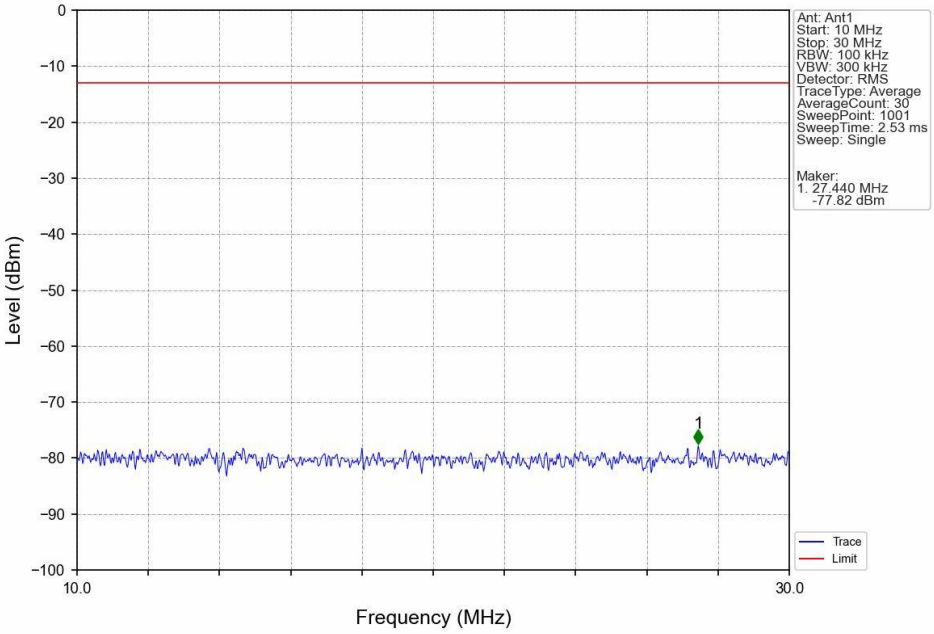

Band12_3MHz_QPSK_LCH_700.5MHz_RB_1_0_NTNV

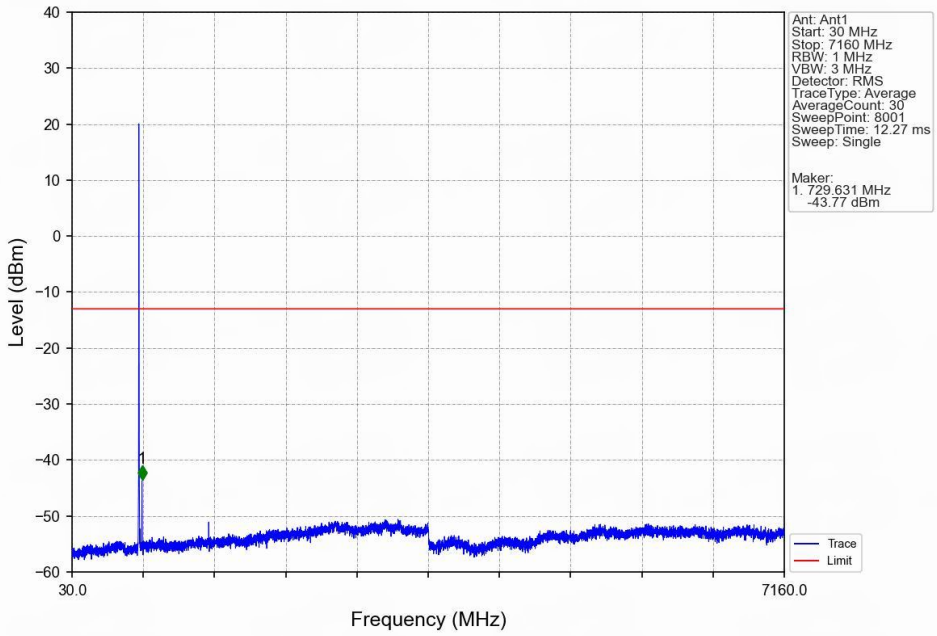


Band12_3MHz_QPSK_LCH_700.5MHz_RB_15_0_NTNV

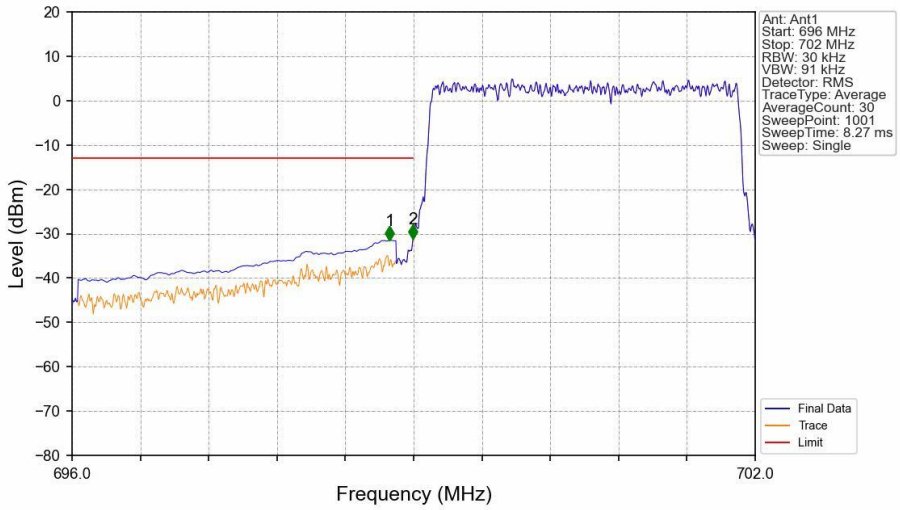


| Start (MHz) | Stop (MHz) | RBW (MHz) | Method | Marker No. | Freq (MHz) | Level (dBm) | Limit (dBm) | Result |
|---|---|---|---|---|---|---|---|---|
| 696 | 698.9 | 0.1 | CHP | 1 | 698.790 | -31.46 | -13 | Pass |
| 698.9 | 699 | 0.03 | / | 2 | 698.994 | -31.16 | -13 | Pass |
| 699 | 702 | 0.03 | / | / | / | / | / | / |

Total or partial reproduction of this document without permission of the Laboratory is not allowed.

BTF Testing Lab (Shenzhen) Co., Ltd.
101/201/301, Building 1, Block 2, Tantou Industrial Park,Tantou Community, Songgang Subdistrict, Bao'an District, Shenzhen, China
Email: info@btf-lab.com Tel: +86-755-23146130 http://www.btf-lab.com

Band12_3MHz_QPSK_MCH_707.5MHz_RB_1_0_NTNV

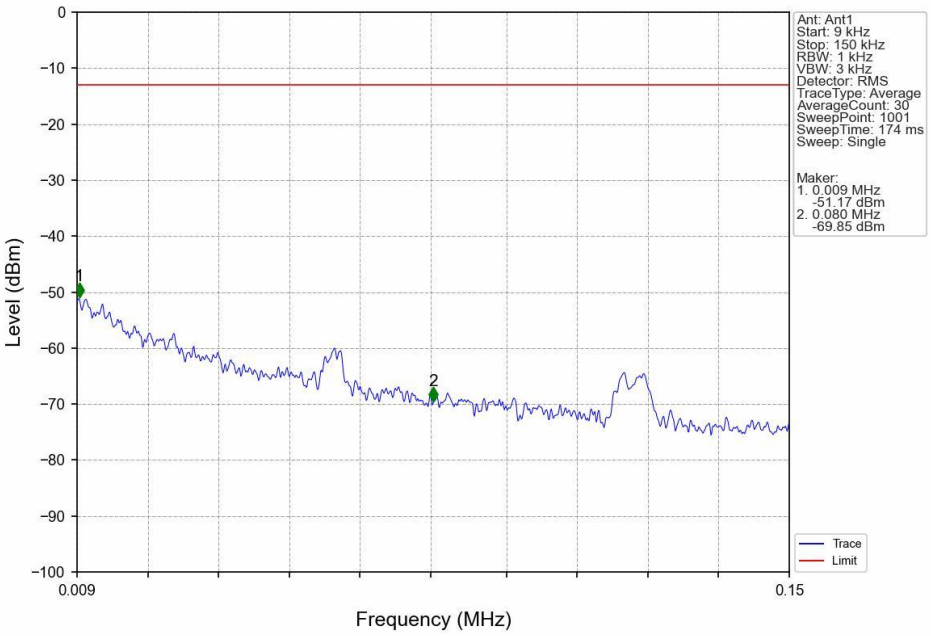


Band12_3MHz_QPSK_MCH_707.5MHz_RB_1_0_NTNV

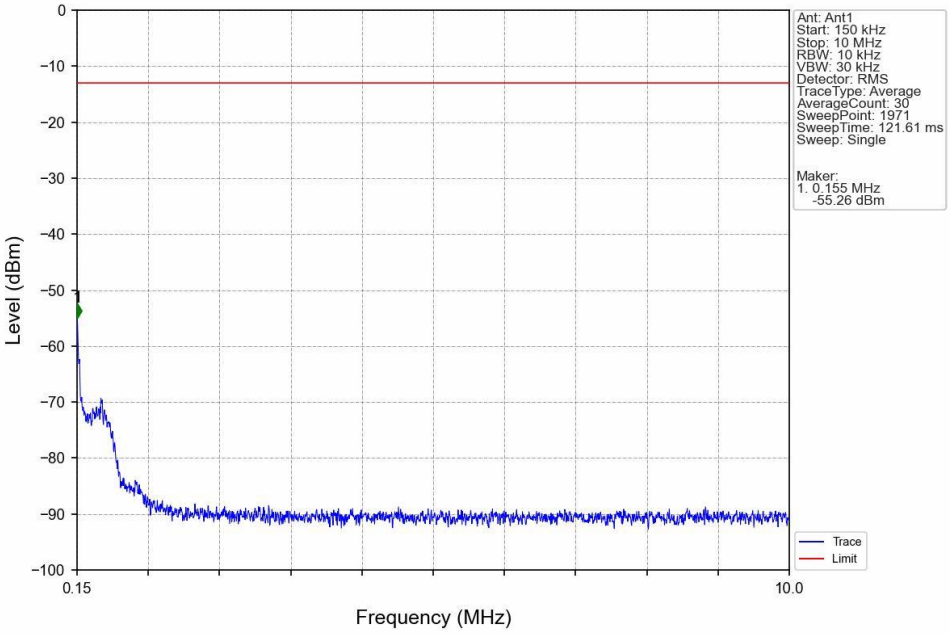

Band12_3MHz_QPSK_MCH_707.5MHz_RB_1_0_NTNV

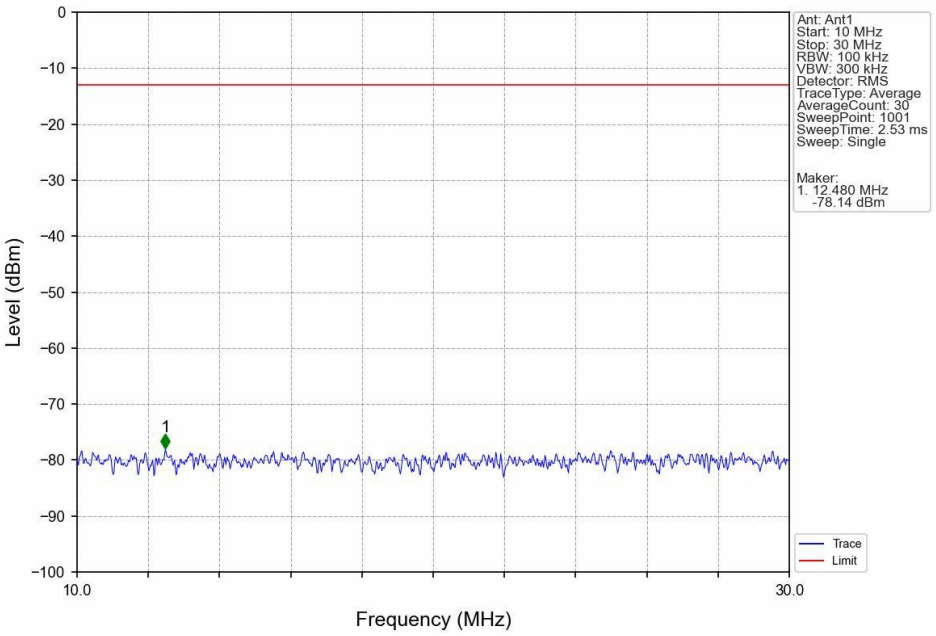


Band12_3MHz_QPSK_MCH_707.5MHz_RB_1_0_NTNV

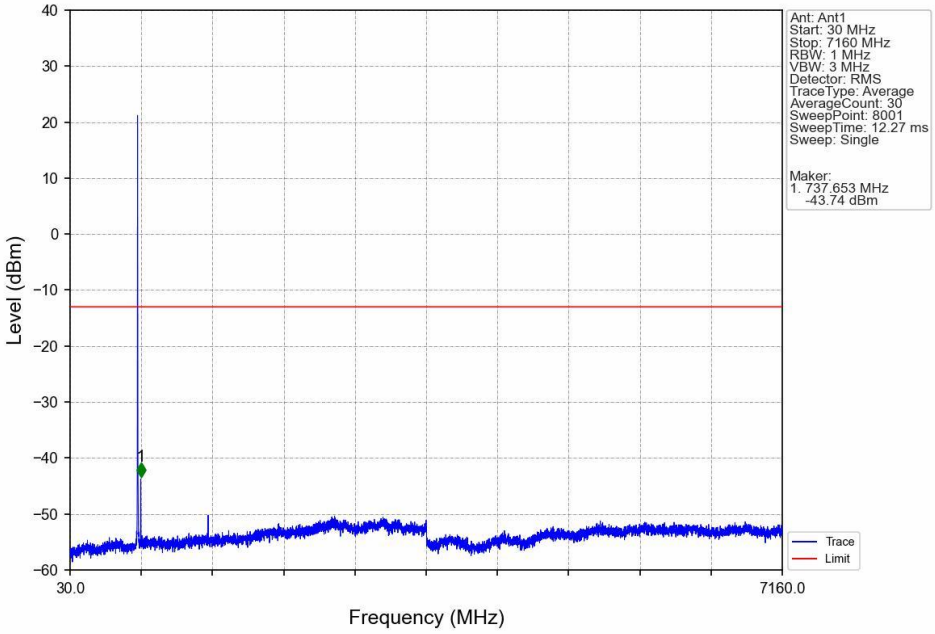

Band12_3MHz_QPSK_HCH_714.5MHz_RB_1_0_NTNV

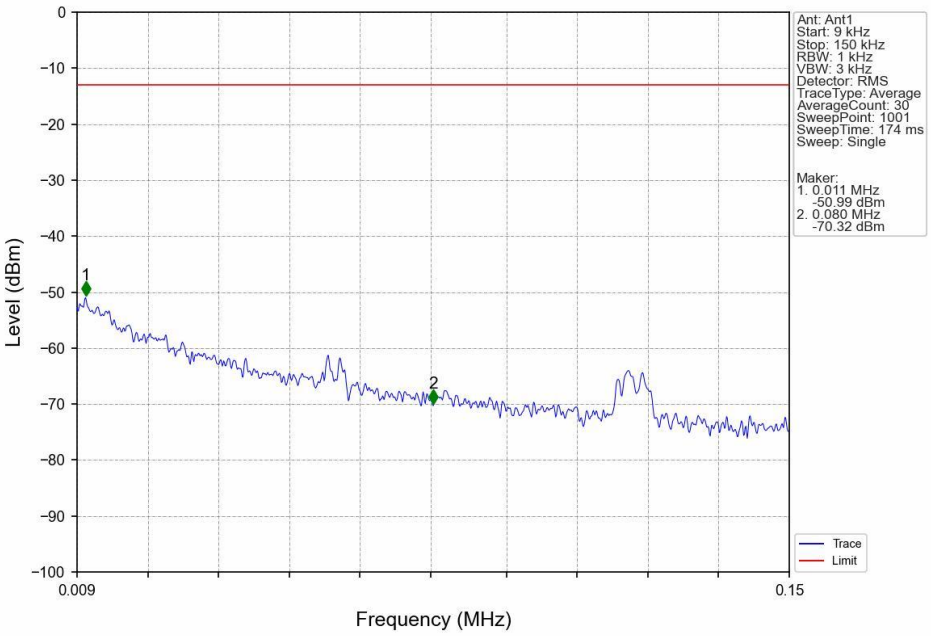


Band12_3MHz_QPSK_HCH_714.5MHz_RB_1_0_NTNV

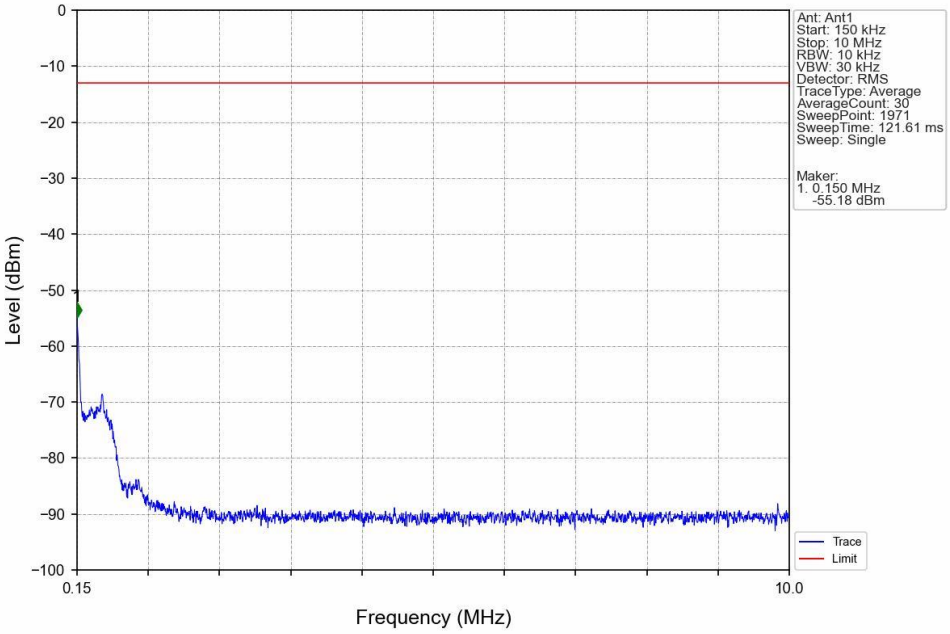

Band12_3MHz_QPSK_HCH_714.5MHz_RB_1_0_NTNV

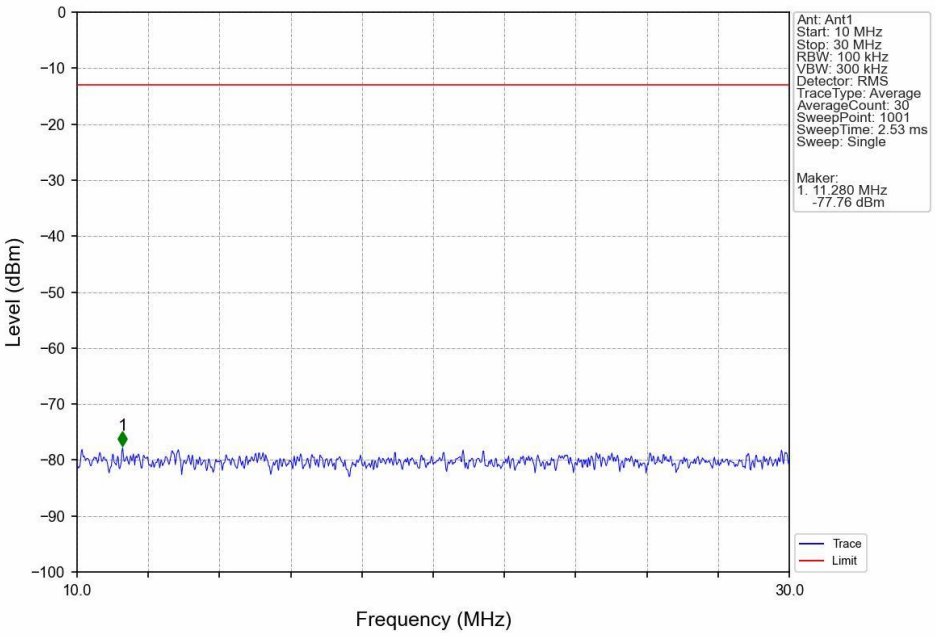


Band12_3MHz_QPSK_HCH_714.5MHz_RB_1_0_NTNV

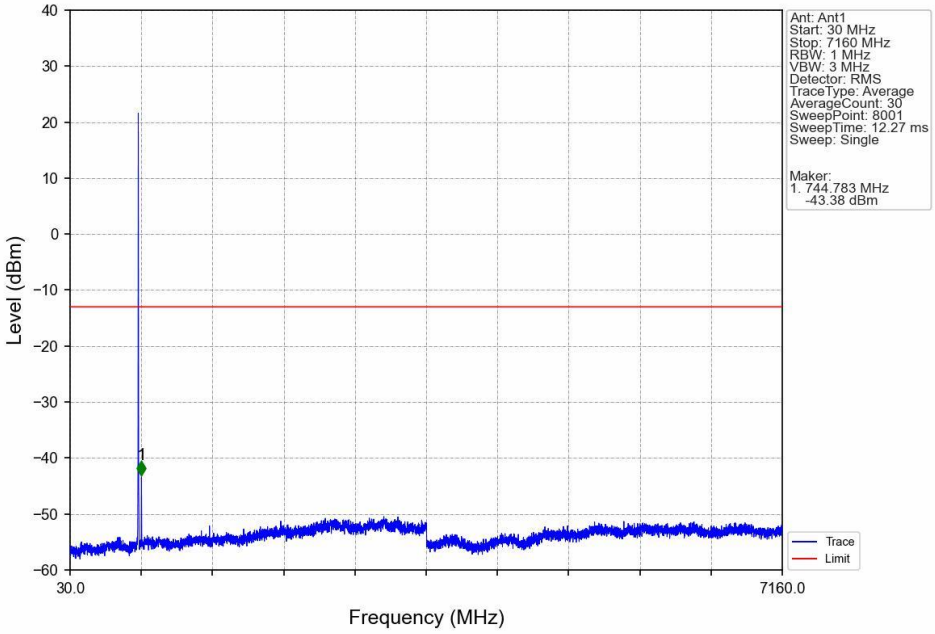

Band12_3MHz_QPSK_HCH_714.5MHz_RB_1_14_NTNV

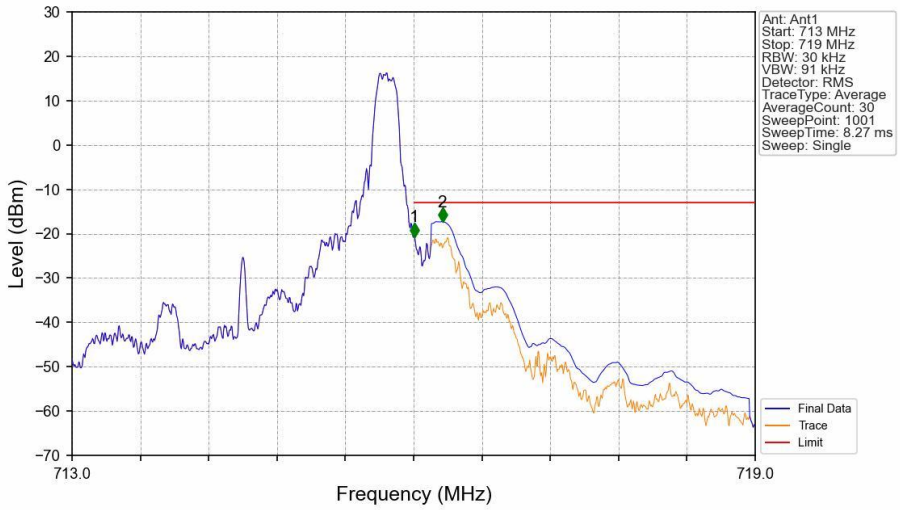


| Start (MHz) | Stop (MHz) | RBW (MHz) | Method | Marker No. | Freq (MHz) | Level (dBm) | Limit (dBm) | Result |
|---|---|---|---|---|---|---|---|---|
| 713 | 716 | 0.03 | / | / | / | / | / | / |
| 716 | 716.1 | 0.03 | / | 1 | 716.006 | -20.67 | -13 | Pass |
| 716.1 | 719 | 0.1 | CHP | 2 | 716.252 | -17.27 | -13 | Pass |

Band12_3MHz_QPSK_HCH_714.5MHz_RB_15_0_NTNV

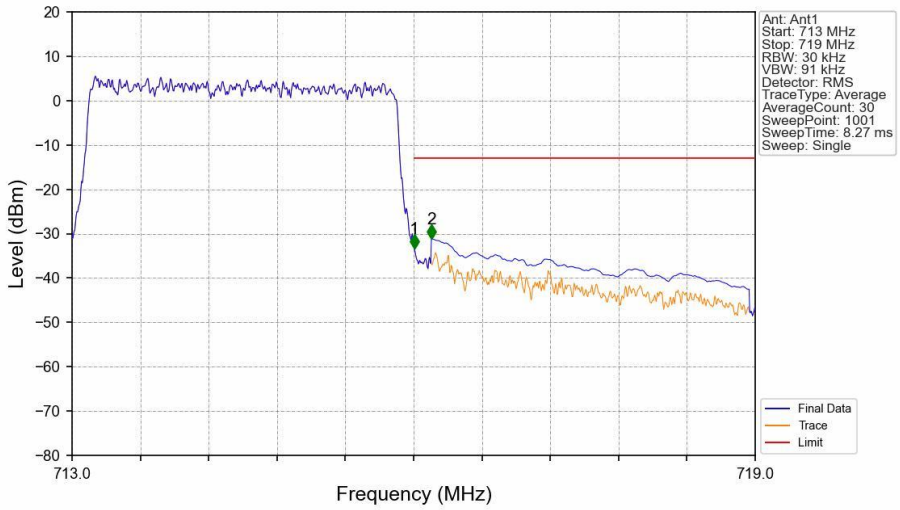


| Start (MHz) | Stop (MHz) | RBW (MHz) | Method | Marker No. | Freq (MHz) | Level (dBm) | Limit (dBm) | Result |
|---|---|---|---|---|---|---|---|---|
| 713 | 716 | 0.03 | / | / | / | / | / | / |
| 716 | 716.1 | 0.03 | / | 1 | 716.006 | -33.33 | -13 | Pass |
| 716.1 | 719 | 0.1 | CHP | 2 | 716.156 | -31.13 | -13 | Pass |

Total or partial reproduction of this document without permission of the Laboratory is not allowed.

BTF Testing Lab (Shenzhen) Co., Ltd.
101/201/301, Building 1, Block 2, Tantou Industrial Park,Tantou Community, Songgang Subdistrict, Bao'an District, Shenzhen, China
Email: info@btf-lab.com Tel: +86-755-23146130 http://www.btf-lab.com

Band12_3MHz_16QAM_LCH_700.5MHz_RB_1_0_NTNV

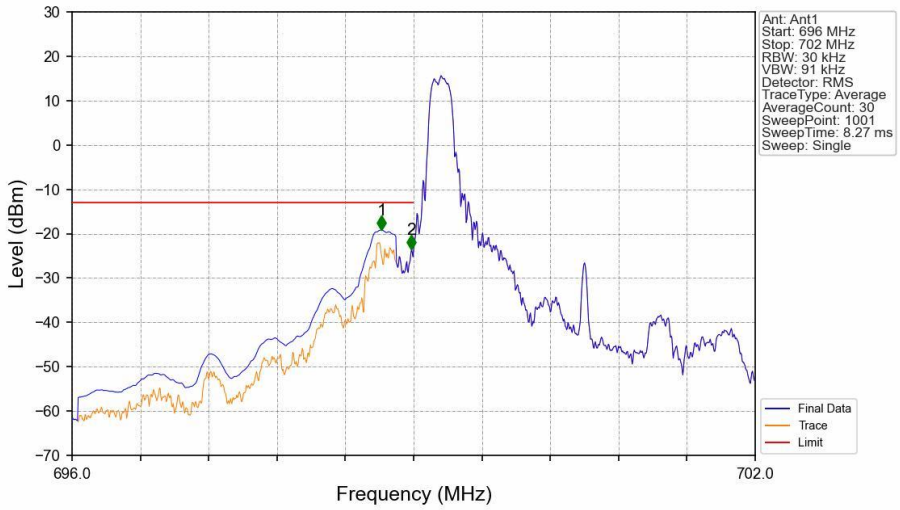


| Start (MHz) | Stop (MHz) | RBW (MHz) | Method | Marker No. | Freq (MHz) | Level (dBm) | Limit (dBm) | Result |
|---|---|---|---|---|---|---|---|---|
| 696 | 698.9 | 0.1 | CHP | 1 | 698.718 | -19.11 | -13 | Pass |
| 698.9 | 699 | 0.03 | / | 2 | 698.982 | -23.57 | -13 | Pass |
| 699 | 702 | 0.03 | / | / | / | / | / | / |

Band12_3MHz_16QAM_LCH_700.5MHz_RB_1_0_NTNV

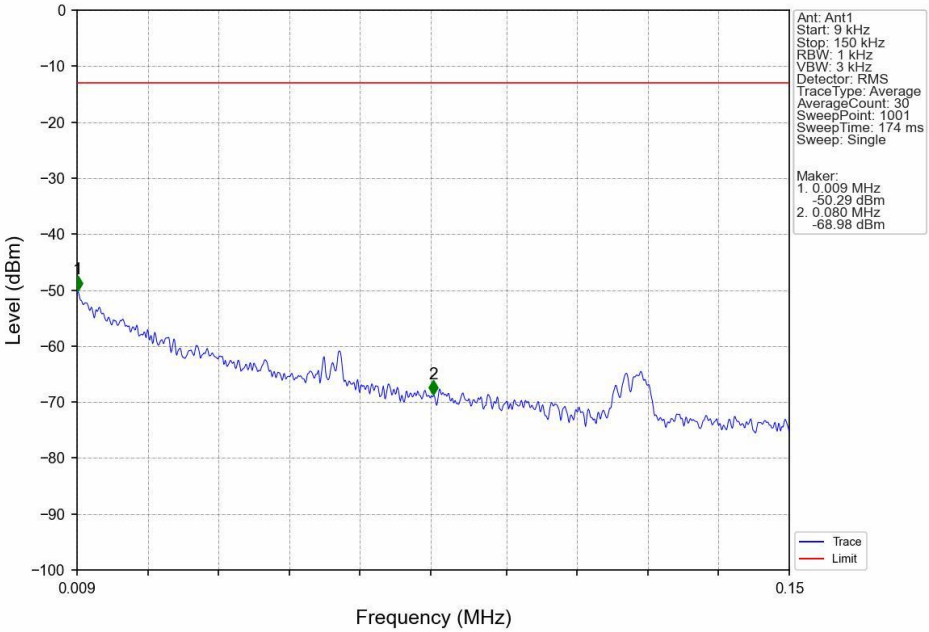

Band12_3MHz_16QAM_LCH_700.5MHz_RB_1_0_NTNV

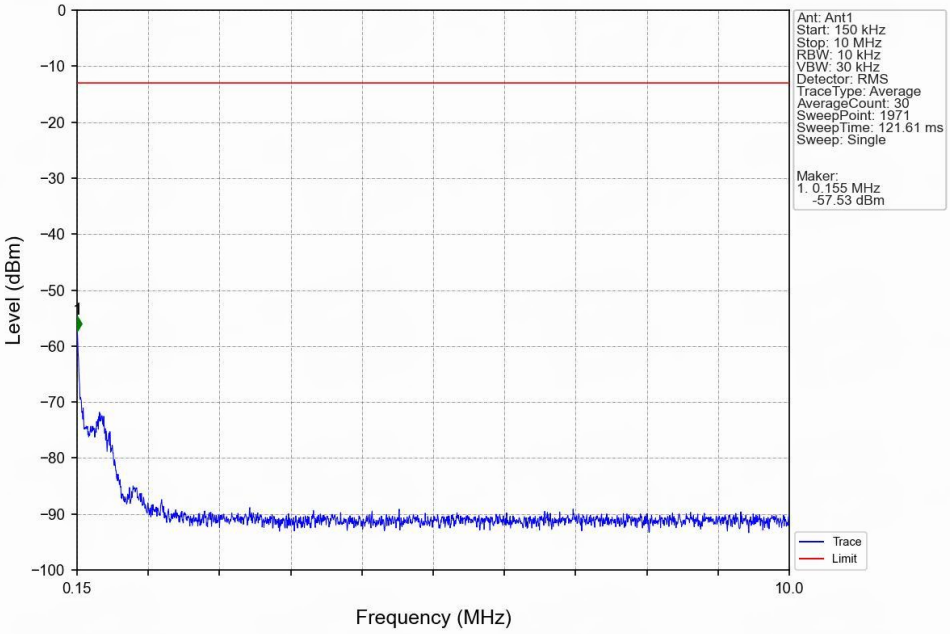


Band12_3MHz_16QAM_LCH_700.5MHz_RB_1_0_NTNV

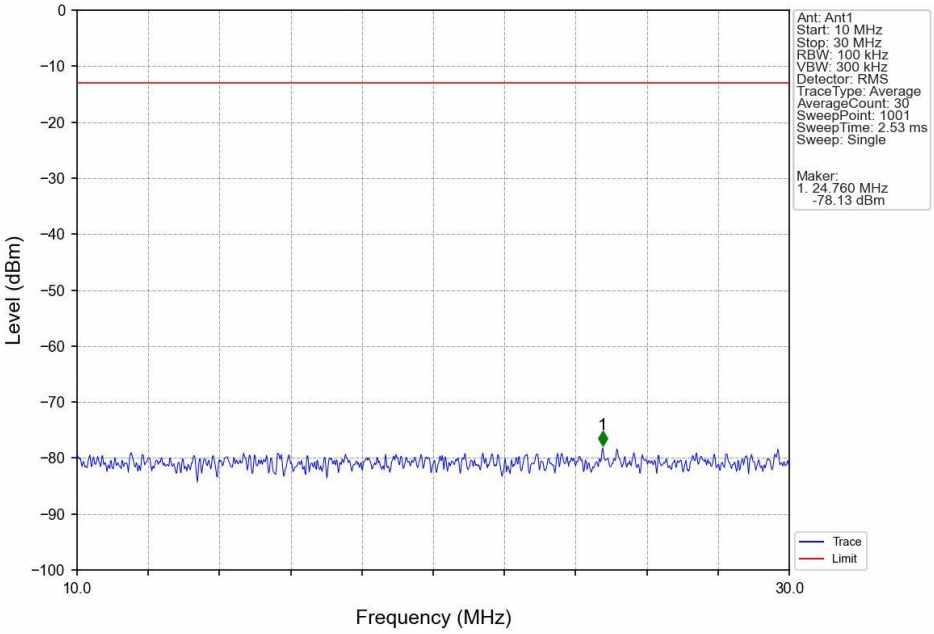

Band12_3MHz_16QAM_LCH_700.5MHz_RB_1_0_NTNV

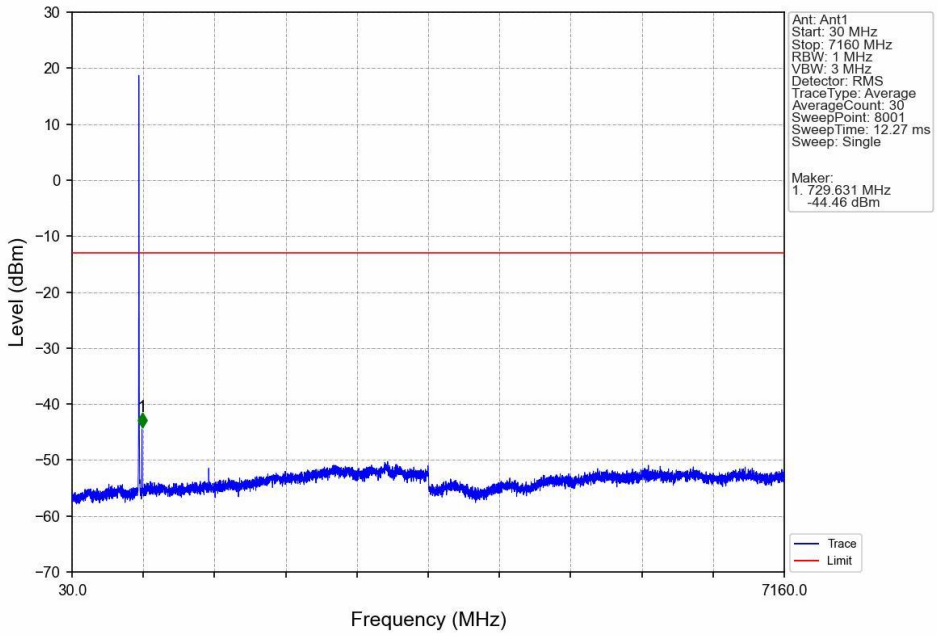


Band12_3MHz_16QAM_LCH_700.5MHz_RB_15_0_NTNV

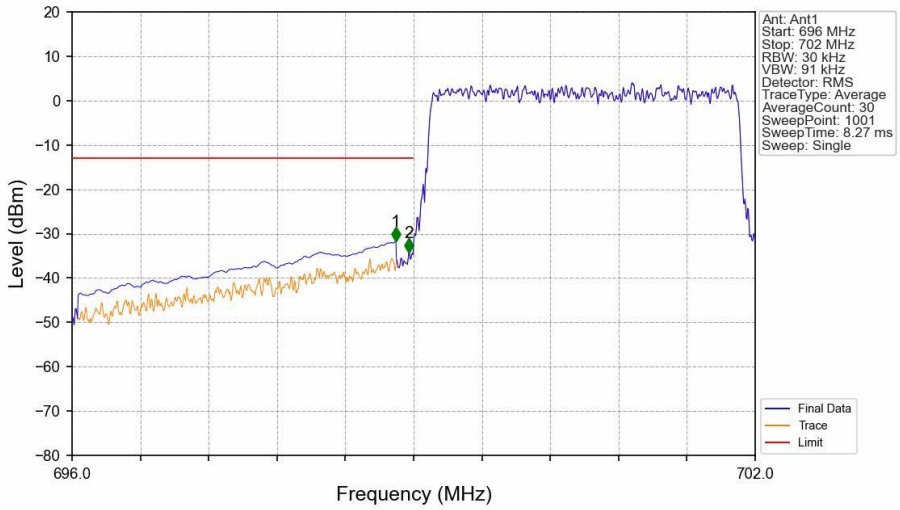


| Start (MHz) | Stop (MHz) | RBW (MHz) | Method | Marker No. | Freq (MHz) | Level (dBm) | Limit (dBm) | Result |
|---|---|---|---|---|---|---|---|---|
| 696 | 698.9 | 0.1 | CHP | 1 | 698.844 | -31.75 | -13 | Pass |
| 698.9 | 699 | 0.03 | / | 2 | 698.958 | -34.26 | -13 | Pass |
| 699 | 702 | 0.03 | / | / | / | / | / | / |

Total or partial reproduction of this document without permission of the Laboratory is not allowed.

BTF Testing Lab (Shenzhen) Co., Ltd.
101/201/301, Building 1, Block 2, Tantou Industrial Park,Tantou Community, Songgang Subdistrict, Bao'an District, Shenzhen, China
Email: info@btf-lab.com Tel: +86-755-23146130 http://www.btf-lab.com

Band12_3MHz_16QAM_MCH_707.5MHz_RB_1_0_NTNV

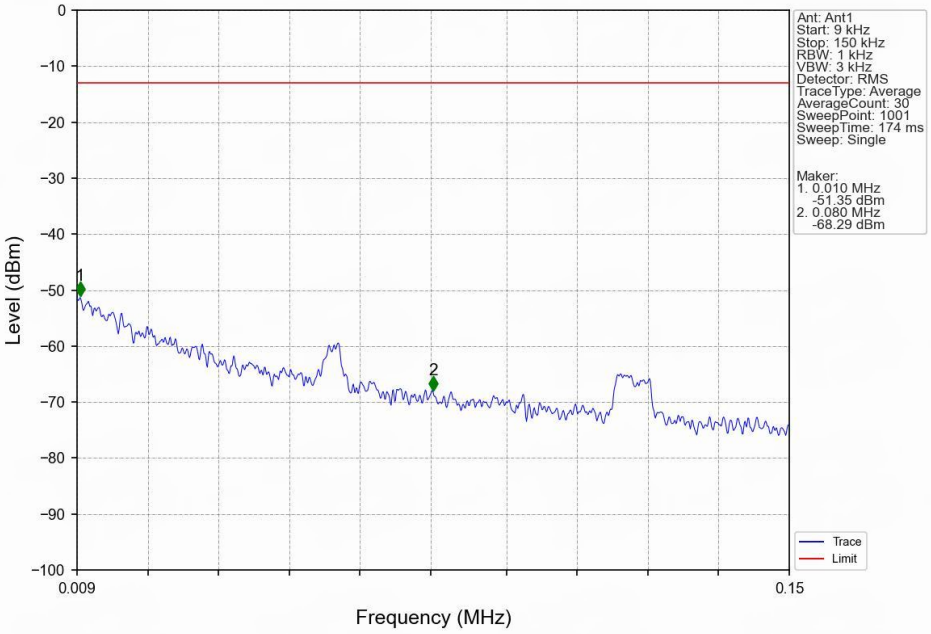


Band12_3MHz_16QAM_MCH_707.5MHz_RB_1_0_NTNV

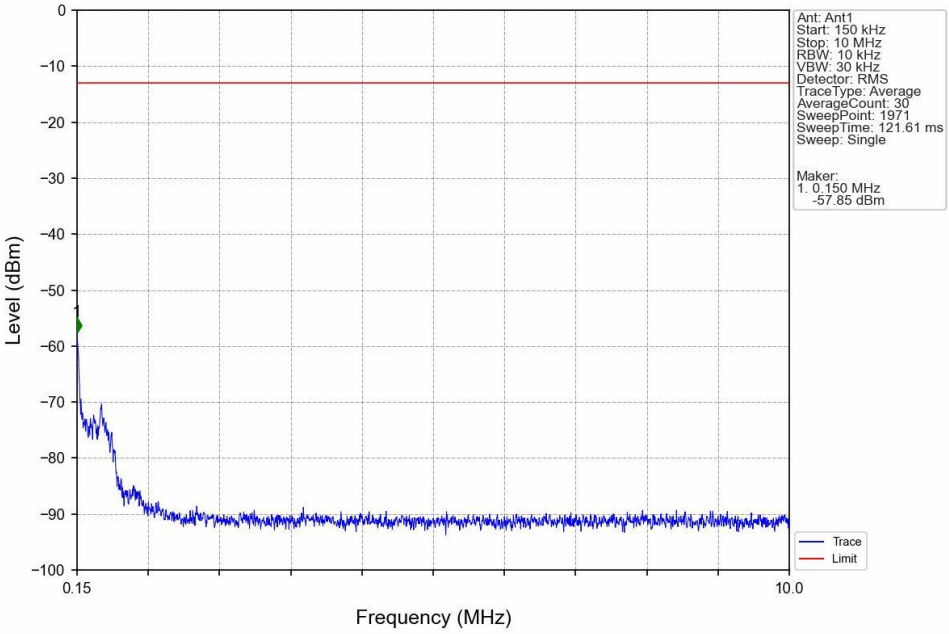

Band12_3MHz_16QAM_MCH_707.5MHz_RB_1_0_NTNV

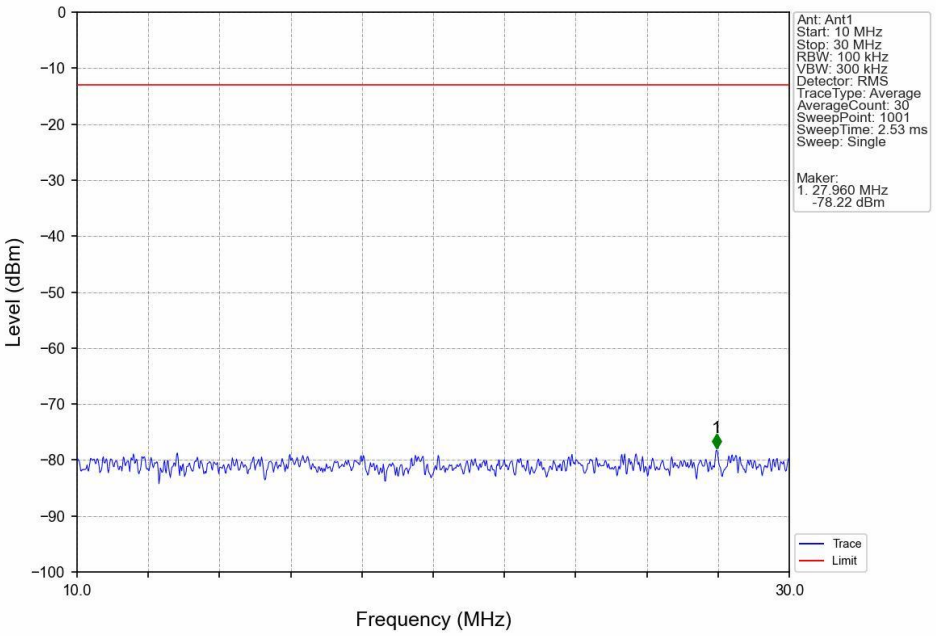


Band12_3MHz_16QAM_MCH_707.5MHz_RB_1_0_NTNV

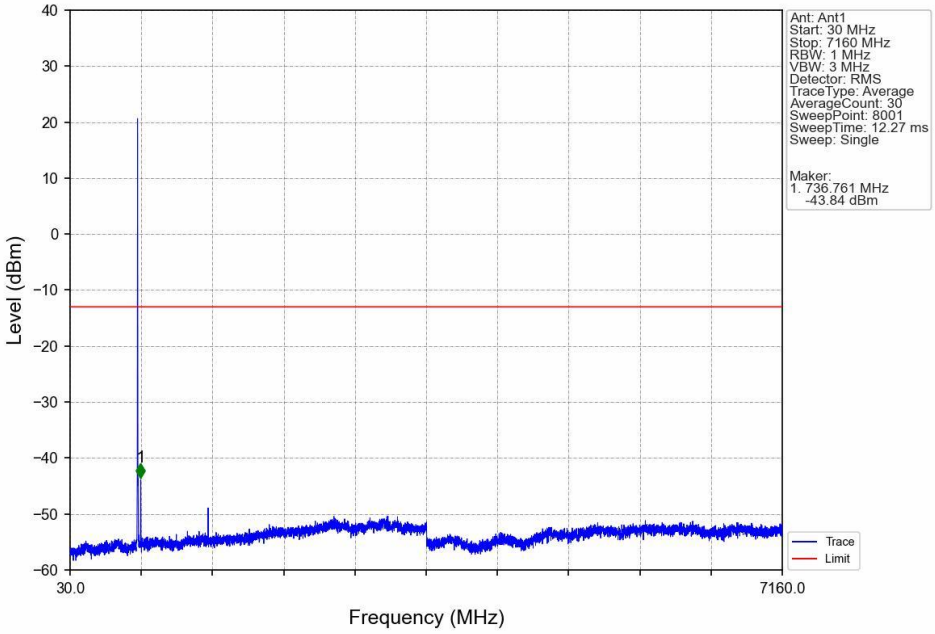

Band12_3MHz_16QAM_HCH_714.5MHz_RB_1_0_NTNV

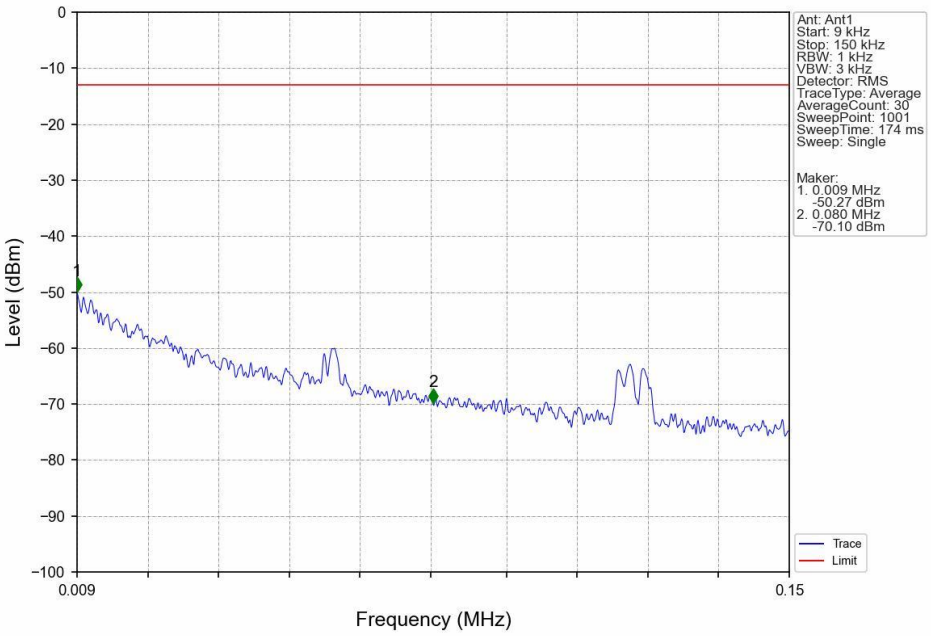


Band12_3MHz_16QAM_HCH_714.5MHz_RB_1_0_NTNV

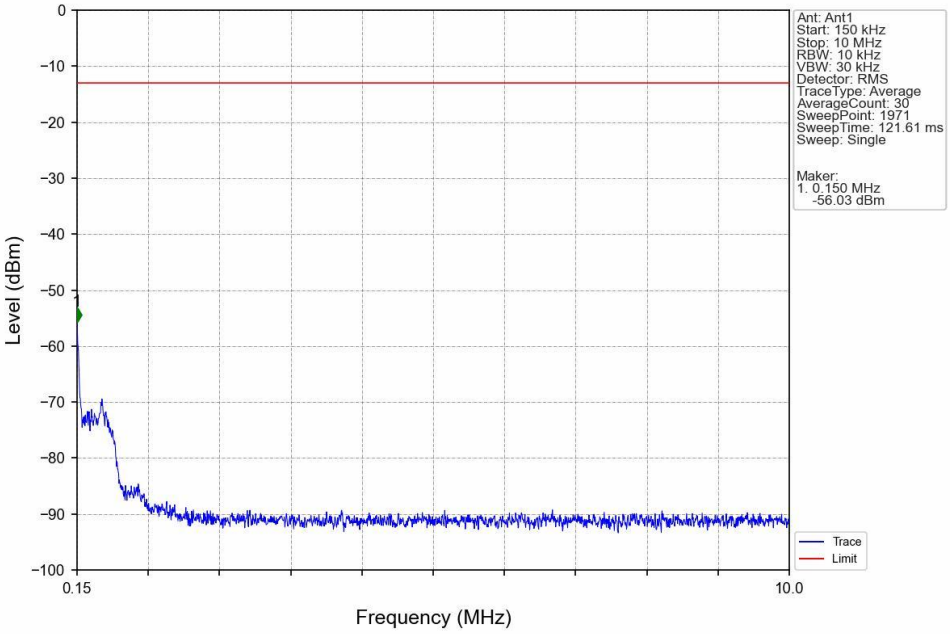

Band12_3MHz_16QAM_HCH_714.5MHz_RB_1_0_NTNV

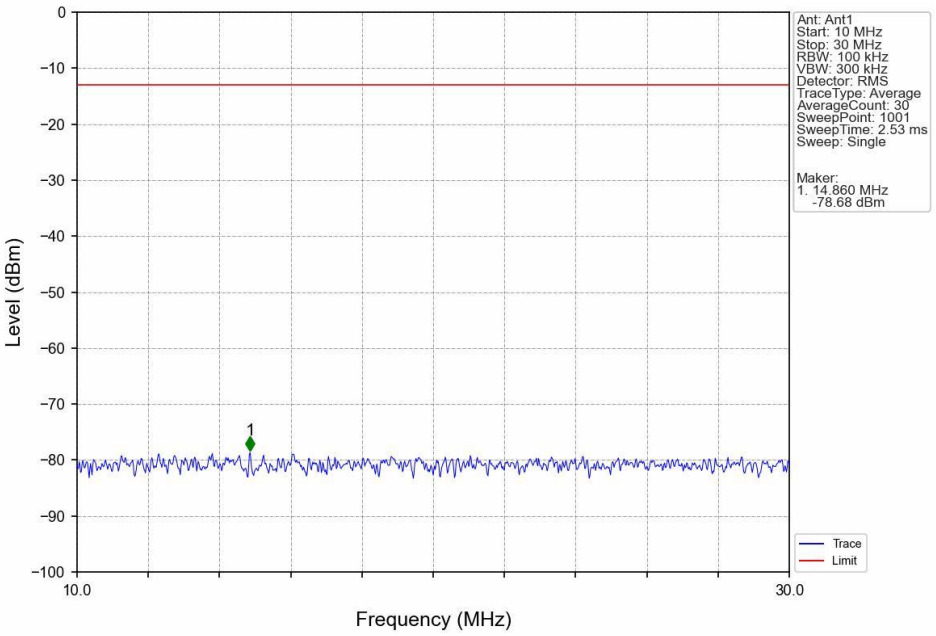


Band12_3MHz_16QAM_HCH_714.5MHz_RB_1_0_NTNV

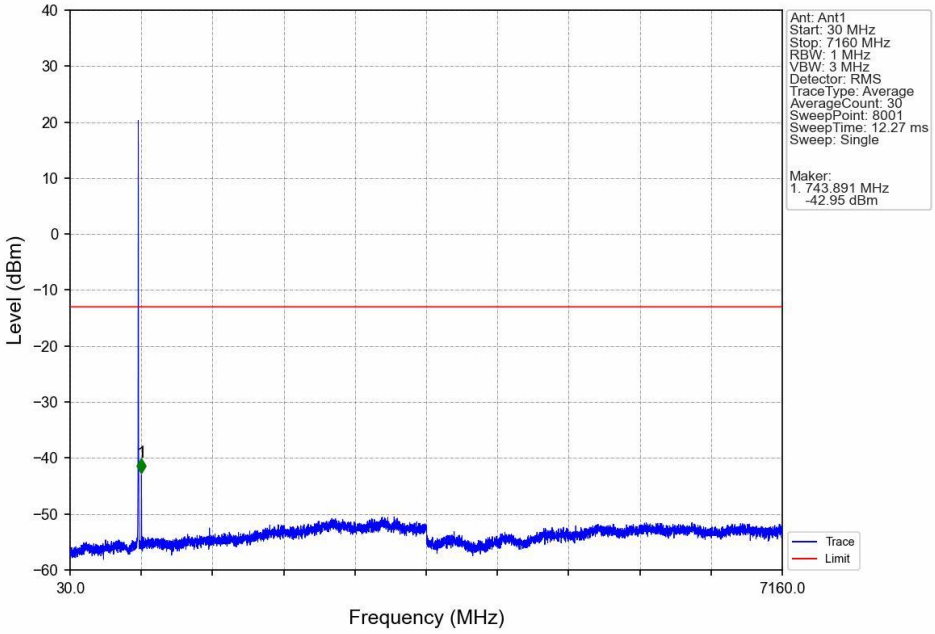

Band12_3MHz_16QAM_HCH_714.5MHz_RB_1_14_NTNV

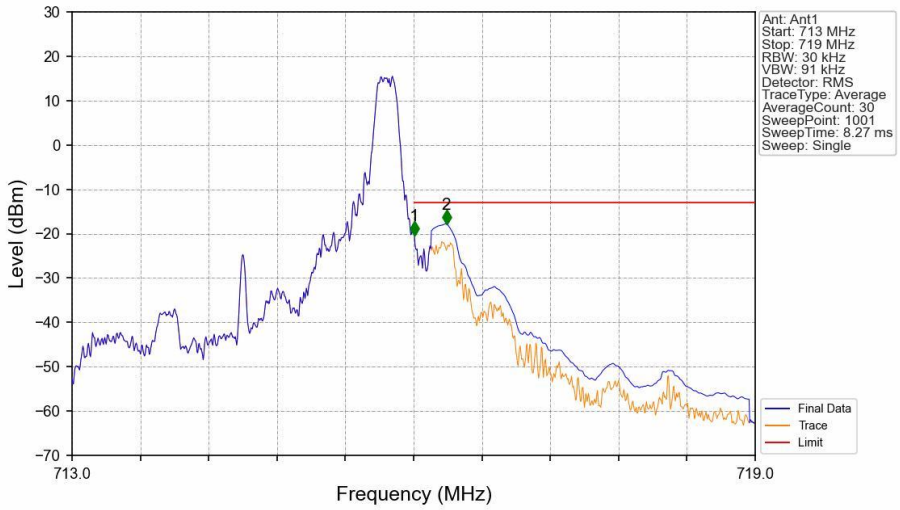


| Start (MHz) | Stop (MHz) | RBW (MHz) | Method | Marker No. | Freq (MHz) | Level (dBm) | Limit (dBm) | Result |
|---|---|---|---|---|---|---|---|---|
| 713 | 716 | 0.03 | / | / | / | / | / | / |
| 716 | 716.1 | 0.03 | / | 1 | 716.006 | -20.43 | -13 | Pass |
| 716.1 | 719 | 0.1 | CHP | 2 | 716.288 | -17.77 | -13 | Pass |

Band12_3MHz_16QAM_HCH_714.5MHz_RB_15_0_NTNV

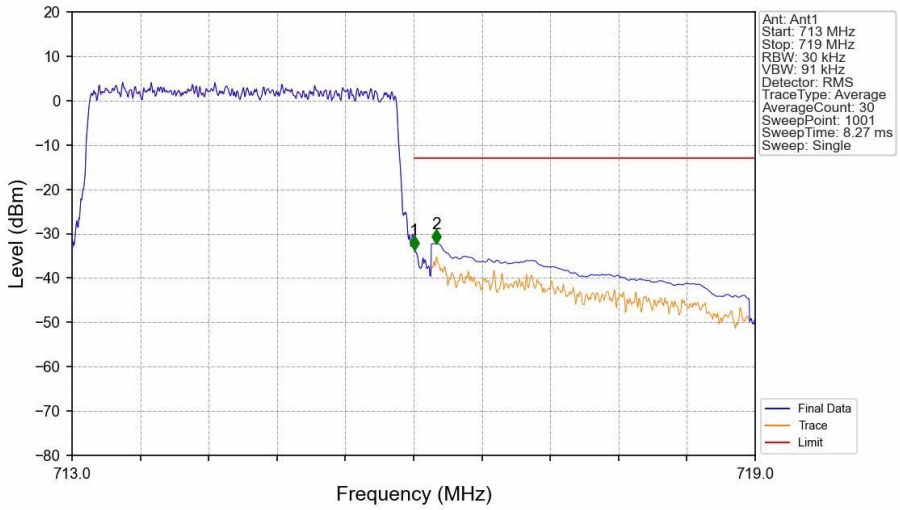


| Start (MHz) | Stop (MHz) | RBW (MHz) | Method | Marker No. | Freq (MHz) | Level (dBm) | Limit (dBm) | Result |
|---|---|---|---|---|---|---|---|---|
| 713 | 716 | 0.03 | / | / | / | / | / | / |
| 716 | 716.1 | 0.03 | / | 1 | 716.006 | -33.76 | -13 | Pass |
| 716.1 | 719 | 0.1 | CHP | 2 | 716.198 | -32.25 | -13 | Pass |

Total or partial reproduction of this document without permission of the Laboratory is not allowed.

BTF Testing Lab (Shenzhen) Co., Ltd.
101/201/301, Building 1, Block 2, Tantou Industrial Park,Tantou Community, Songgang Subdistrict, Bao'an District, Shenzhen, China
Email: info@btf-lab.com Tel: +86-755-23146130 http://www.btf-lab.com

## 6.2.3 B12_5MHz

Band12_5MHz_QPSK_LCH_701.5MHz_RB_1_0_NTNV

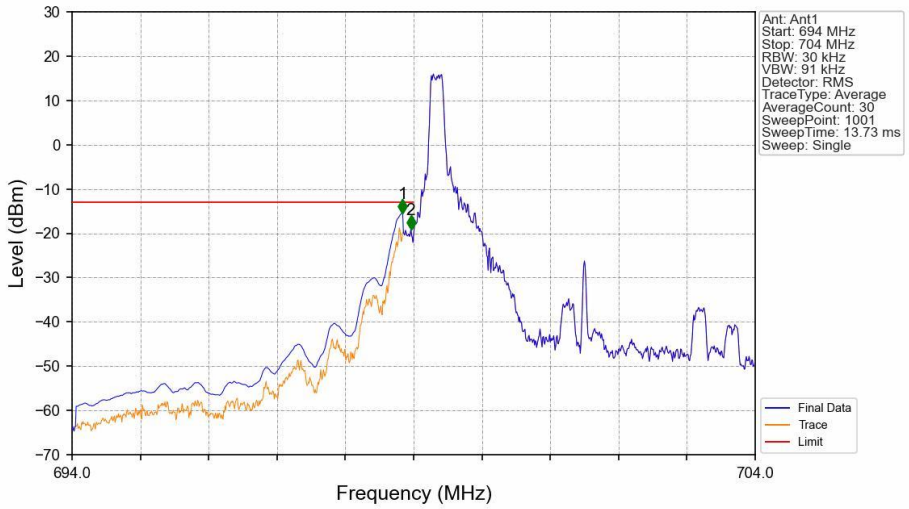


| Start (MHz) | Stop (MHz) | RBW (MHz) | Method | Marker No. | Freq (MHz) | Level (dBm) | Limit (dBm) | Result |
|---|---|---|---|---|---|---|---|---|
| 694 | 698.9 | 0.1 | CHP | 1 | 698.840 | -15.40 | -13 | Pass |
| 698.9 | 699 | 0.03 | / | 2 | 698.960 | -19.11 | -13 | Pass |
| 699 | 704 | 0.03 | / | / | / | / | / | / |

Band12_5MHz_QPSK_LCH_701.5MHz_RB_1_0_NTNV

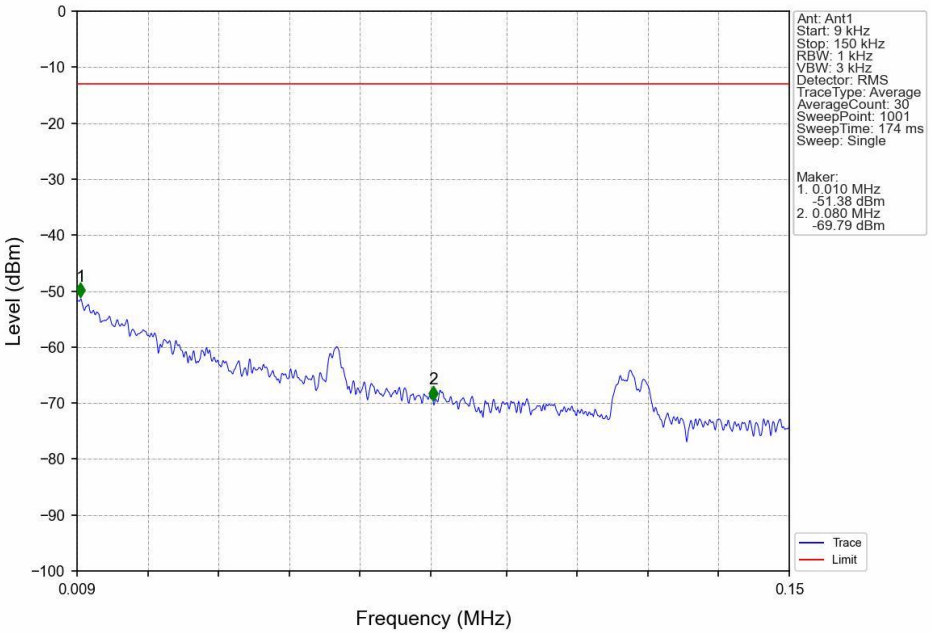

Band12_5MHz_QPSK_LCH_701.5MHz_RB_1_0_NTNV

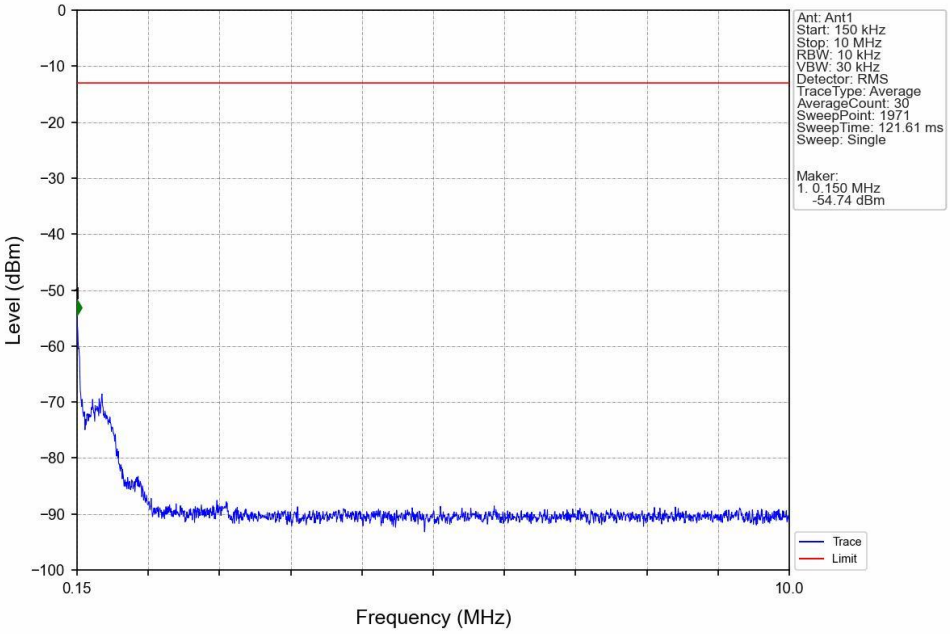


Band12_5MHz_QPSK_LCH_701.5MHz_RB_1_0_NTNV

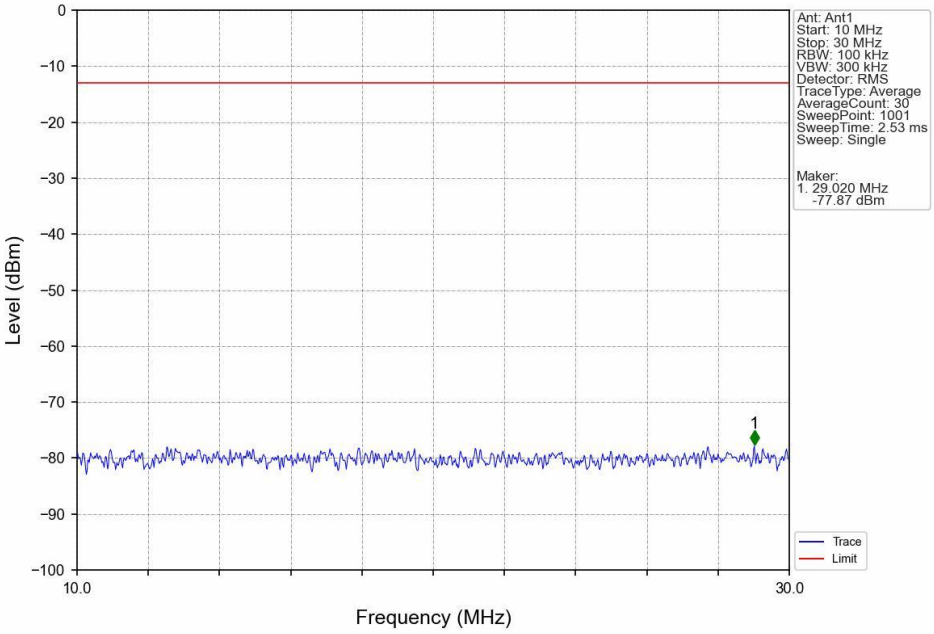

Band12_5MHz_QPSK_LCH_701.5MHz_RB_1_0_NTNV

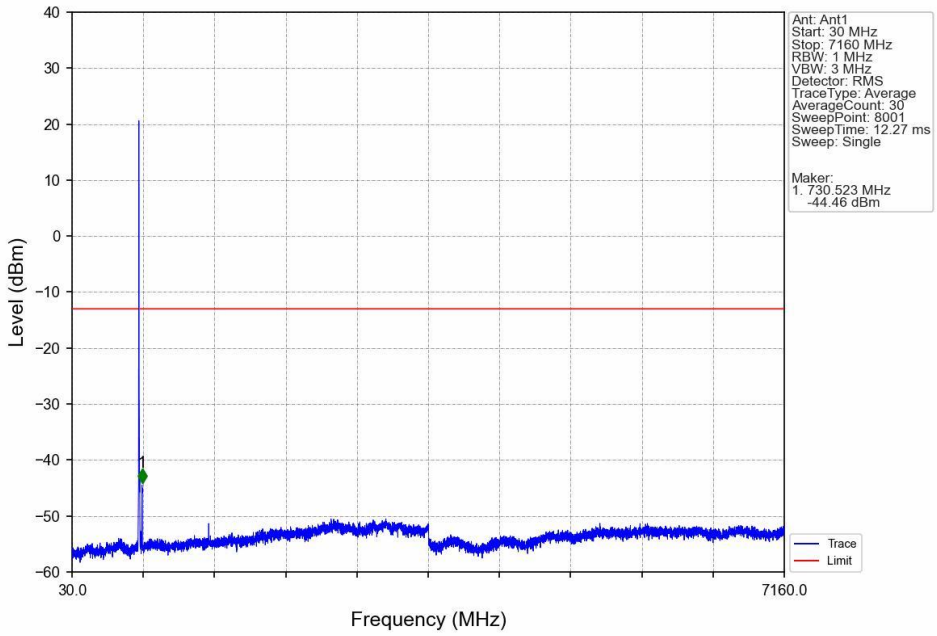


Band12_5MHz_QPSK_LCH_701.5MHz_RB_25_0_NTNV

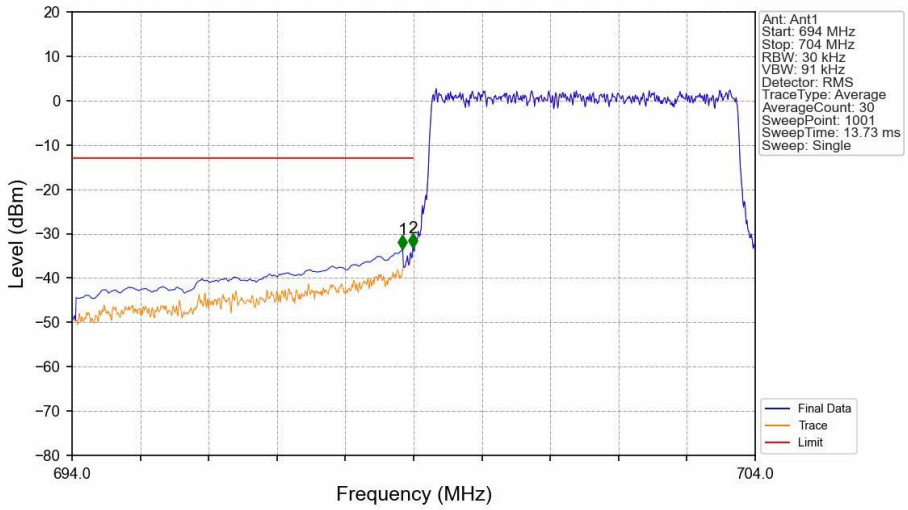


| Start (MHz) | Stop (MHz) | RBW (MHz) | Method | Marker No. | Freq (MHz) | Level (dBm) | Limit (dBm) | Result |
|---|---|---|---|---|---|---|---|---|
| 694 | 698.9 | 0.1 | CHP | 1 | 698.840 | -33.43 | -13 | Pass |
| 698.9 | 699 | 0.03 | / | 2 | 698.990 | -33.15 | -13 | Pass |
| 699 | 704 | 0.03 | / | / | / | / | / | / |

Total or partial reproduction of this document without permission of the Laboratory is not allowed.

BTF Testing Lab (Shenzhen) Co., Ltd.
101/201/301, Building 1, Block 2, Tantou Industrial Park,Tantou Community, Songgang Subdistrict, Bao'an District, Shenzhen, China
Email: info@btf-lab.com Tel: +86-755-23146130 http://www.btf-lab.com

Band12_5MHz_QPSK_MCH_707.5MHz_RB_1_0_NTNV

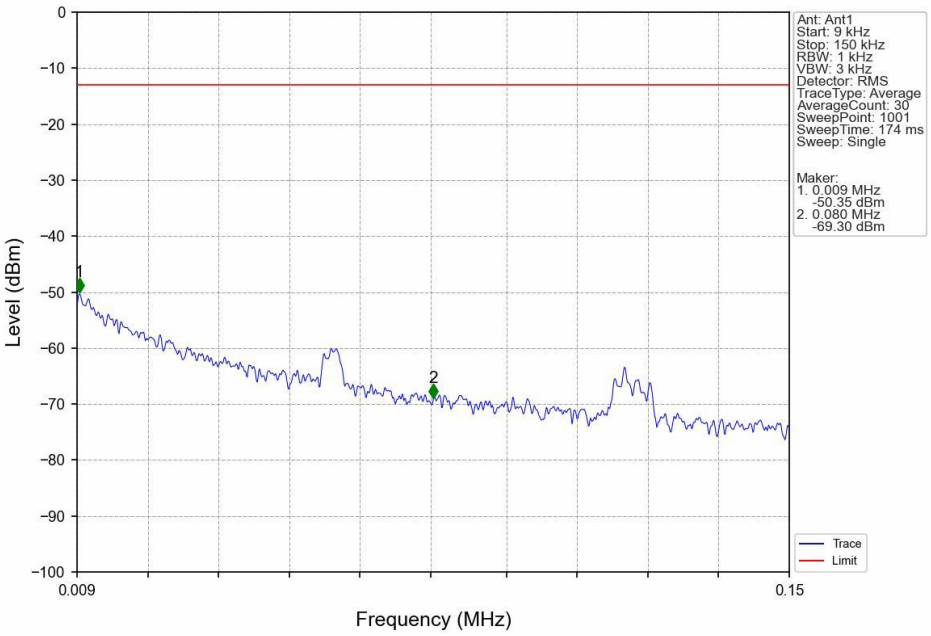


Band12_5MHz_QPSK_MCH_707.5MHz_RB_1_0_NTNV

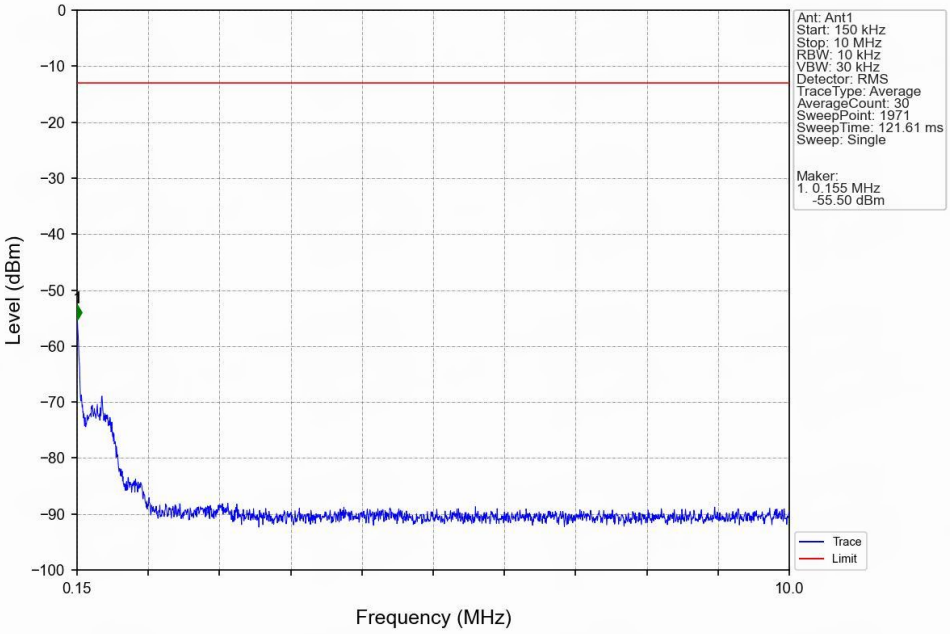

Band12_5MHz_QPSK_MCH_707.5MHz_RB_1_0_NTNV

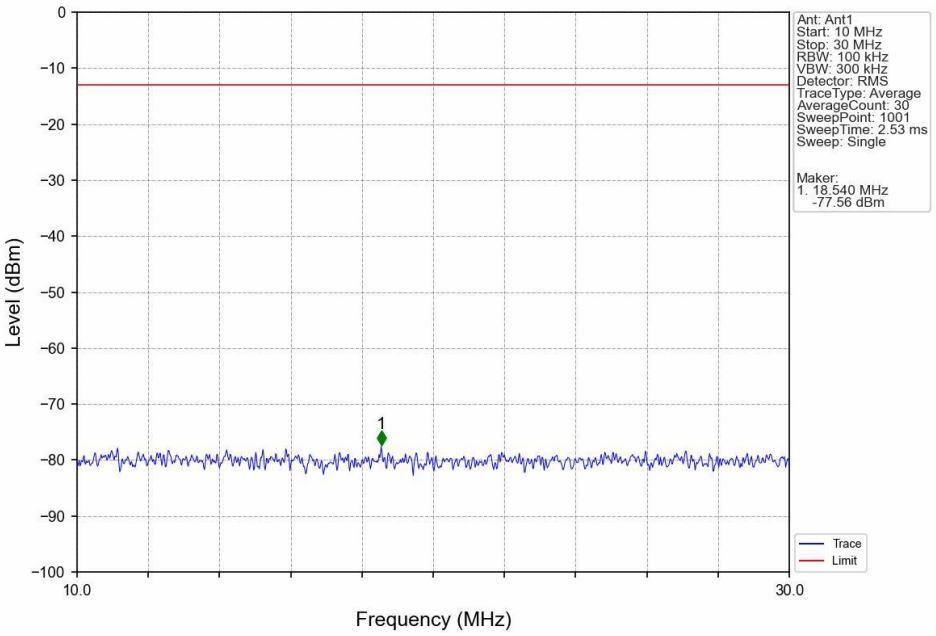


Band12_5MHz_QPSK_MCH_707.5MHz_RB_1_0_NTNV

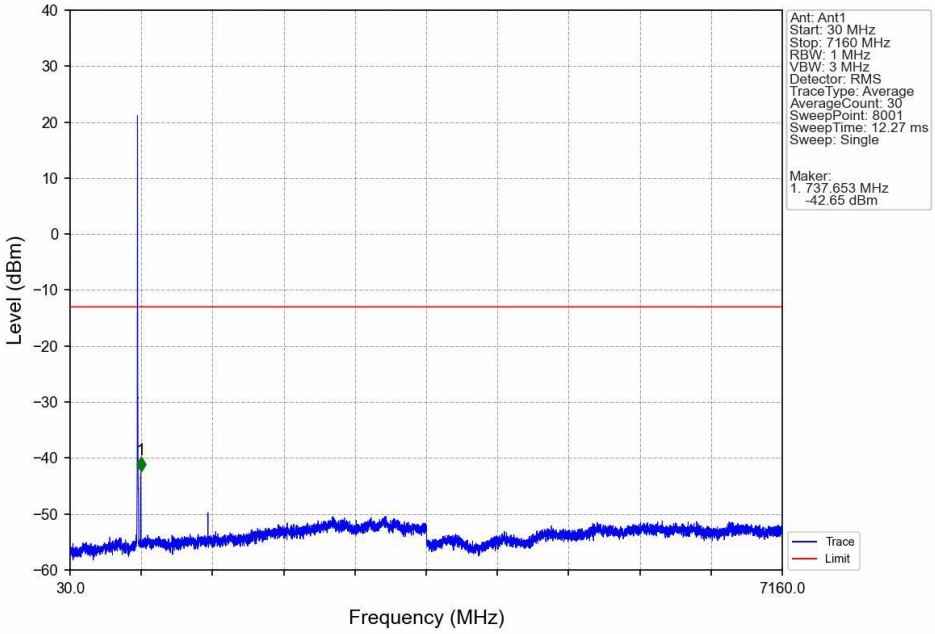

Band12_5MHz_QPSK_HCH_713.5MHz_RB_1_0_NTNV

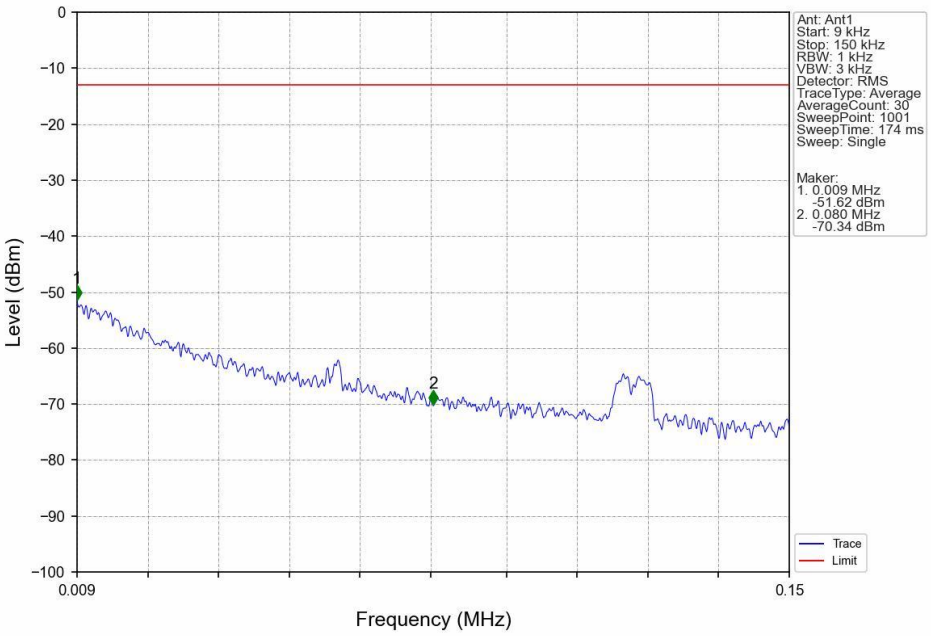


Band12_5MHz_QPSK_HCH_713.5MHz_RB_1_0_NTNV

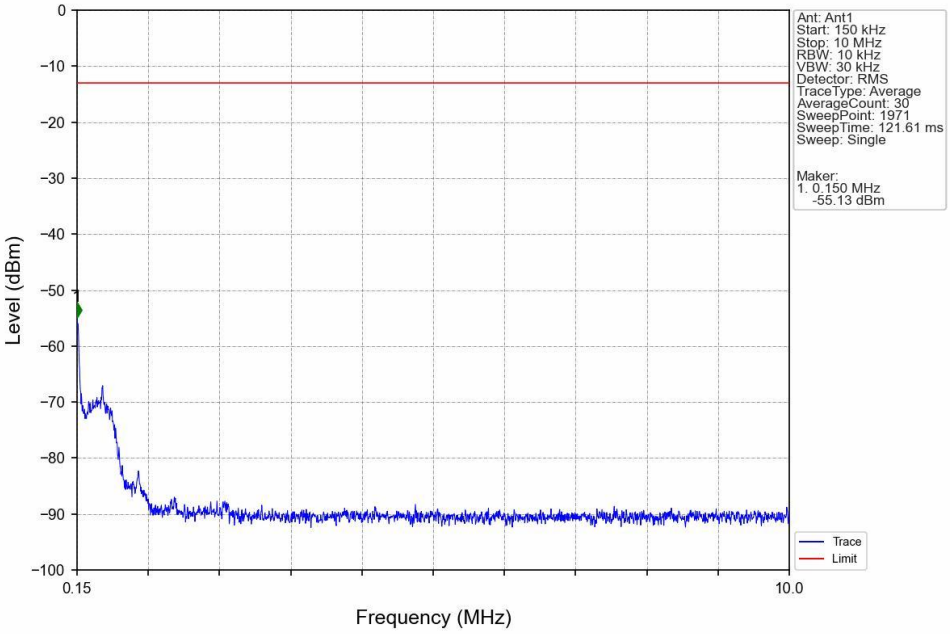

Band12_5MHz_QPSK_HCH_713.5MHz_RB_1_0_NTNV

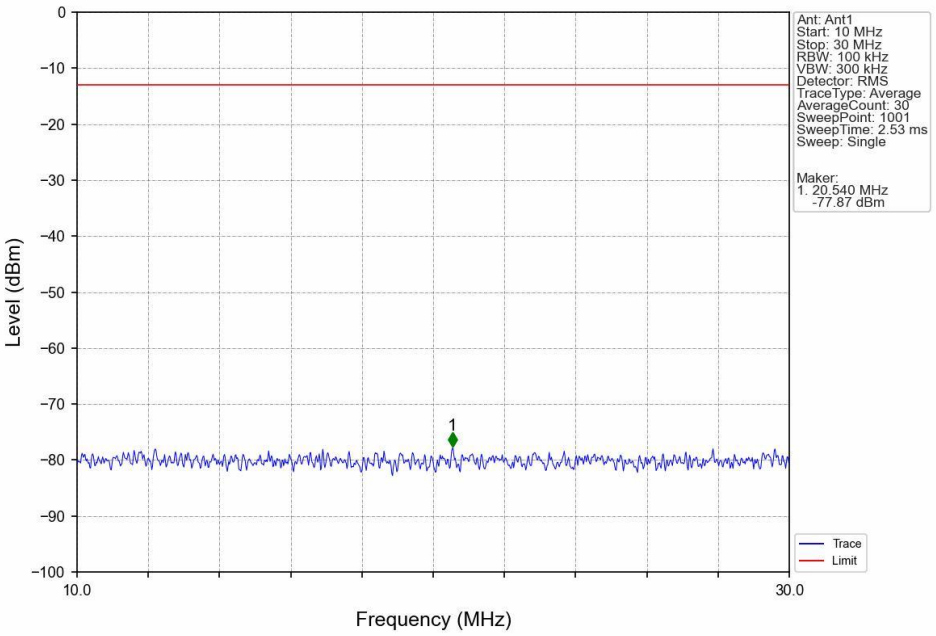

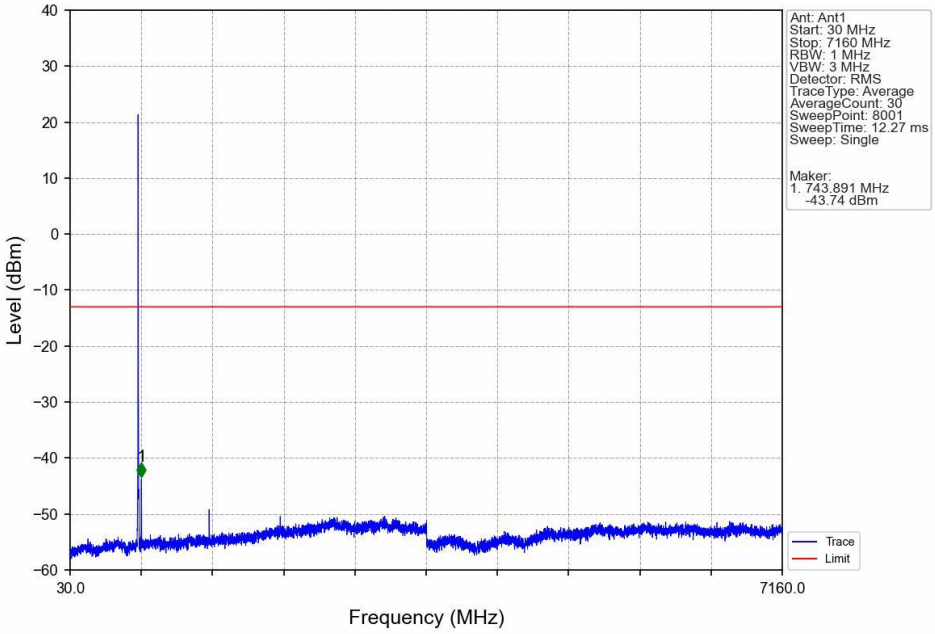
Band12_5MHz_QPSK_HCH_713.5MHz_RB_1_0_NTNV