

Appendix Test Data

Report No.:	9812C50020912501-01	Test Sample No.:	1-2-2
Start Test Date:	2025-11-11	Finish Test Date:	2025-11-17
Test Engineer:	Alex Peng	Auditor:	Justin Feng
Temperature:	23.7°C	Relative Humidity:	39%
Pressure:	101kPa		





Appendix A: 20dB Bandwidth


Test Result

Test Mode	Antenna	Frequency [MHz]	20db EBW[MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	0.957	2401.499	2402.456	---	---
DH5	Ant1	2441	0.996	2440.454	2441.450	---	---
DH5	Ant1	2480	0.987	2479.472	2480.459	---	---
2DH5	Ant1	2402	1.281	2401.331	2402.612	---	---
2DH5	Ant1	2441	1.293	2440.328	2441.621	---	---
2DH5	Ant1	2480	1.281	2479.334	2480.615	---	---
3DH5	Ant1	2402	1.290	2401.316	2402.606	---	---
3DH5	Ant1	2441	1.302	2440.319	2441.621	---	---
3DH5	Ant1	2480	1.308	2479.316	2480.624	---	---

Test Graphs

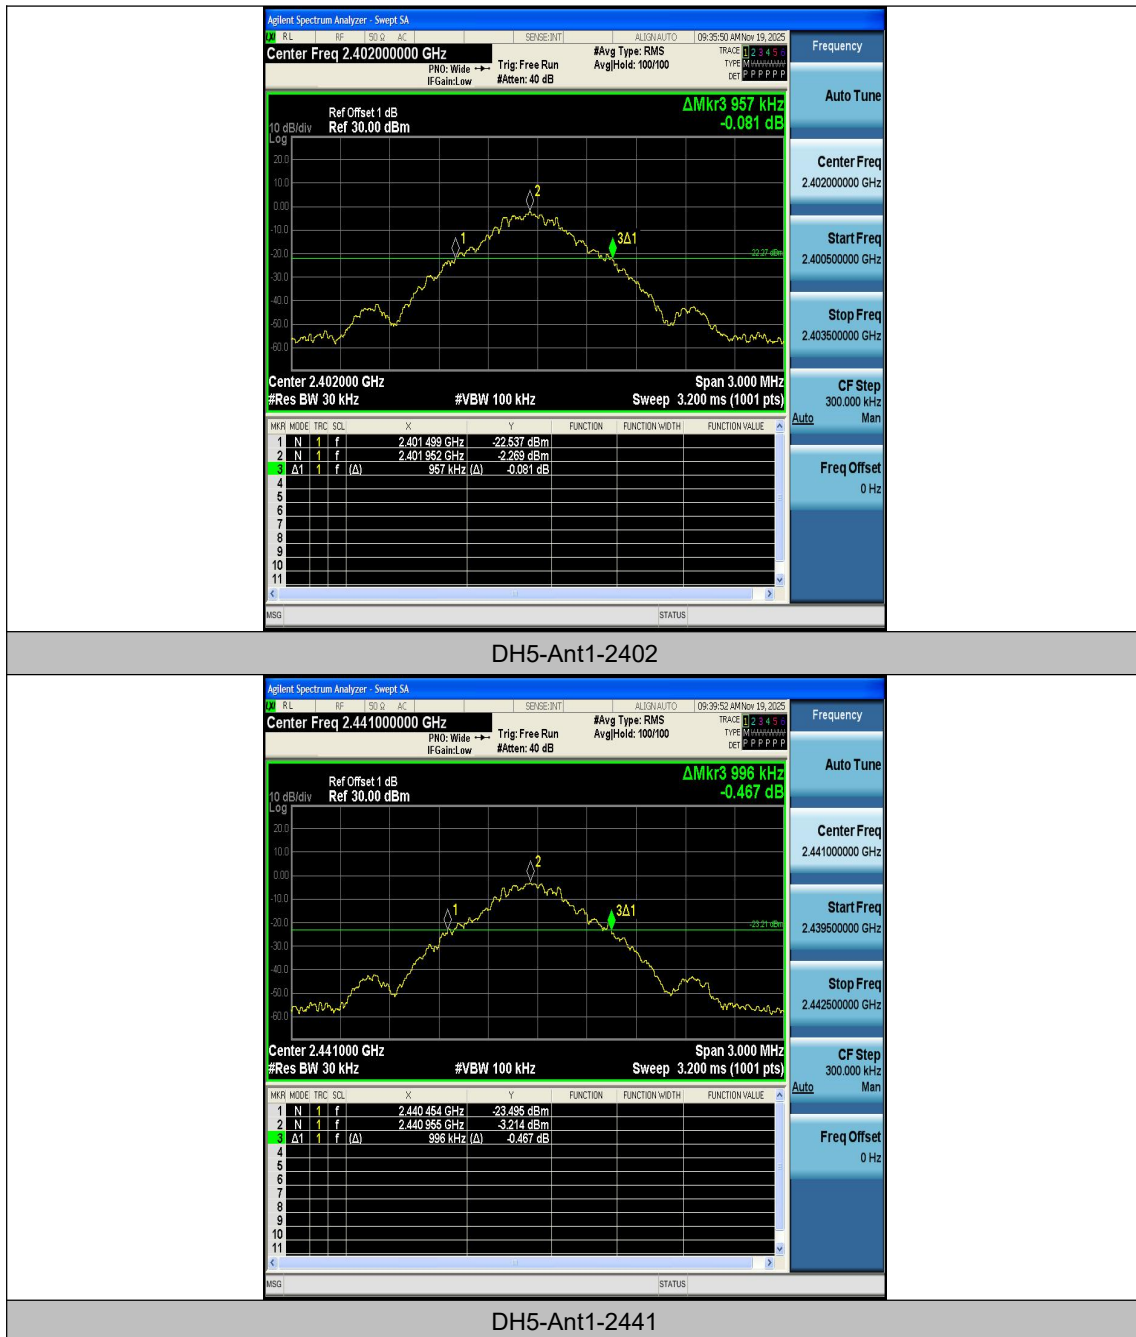

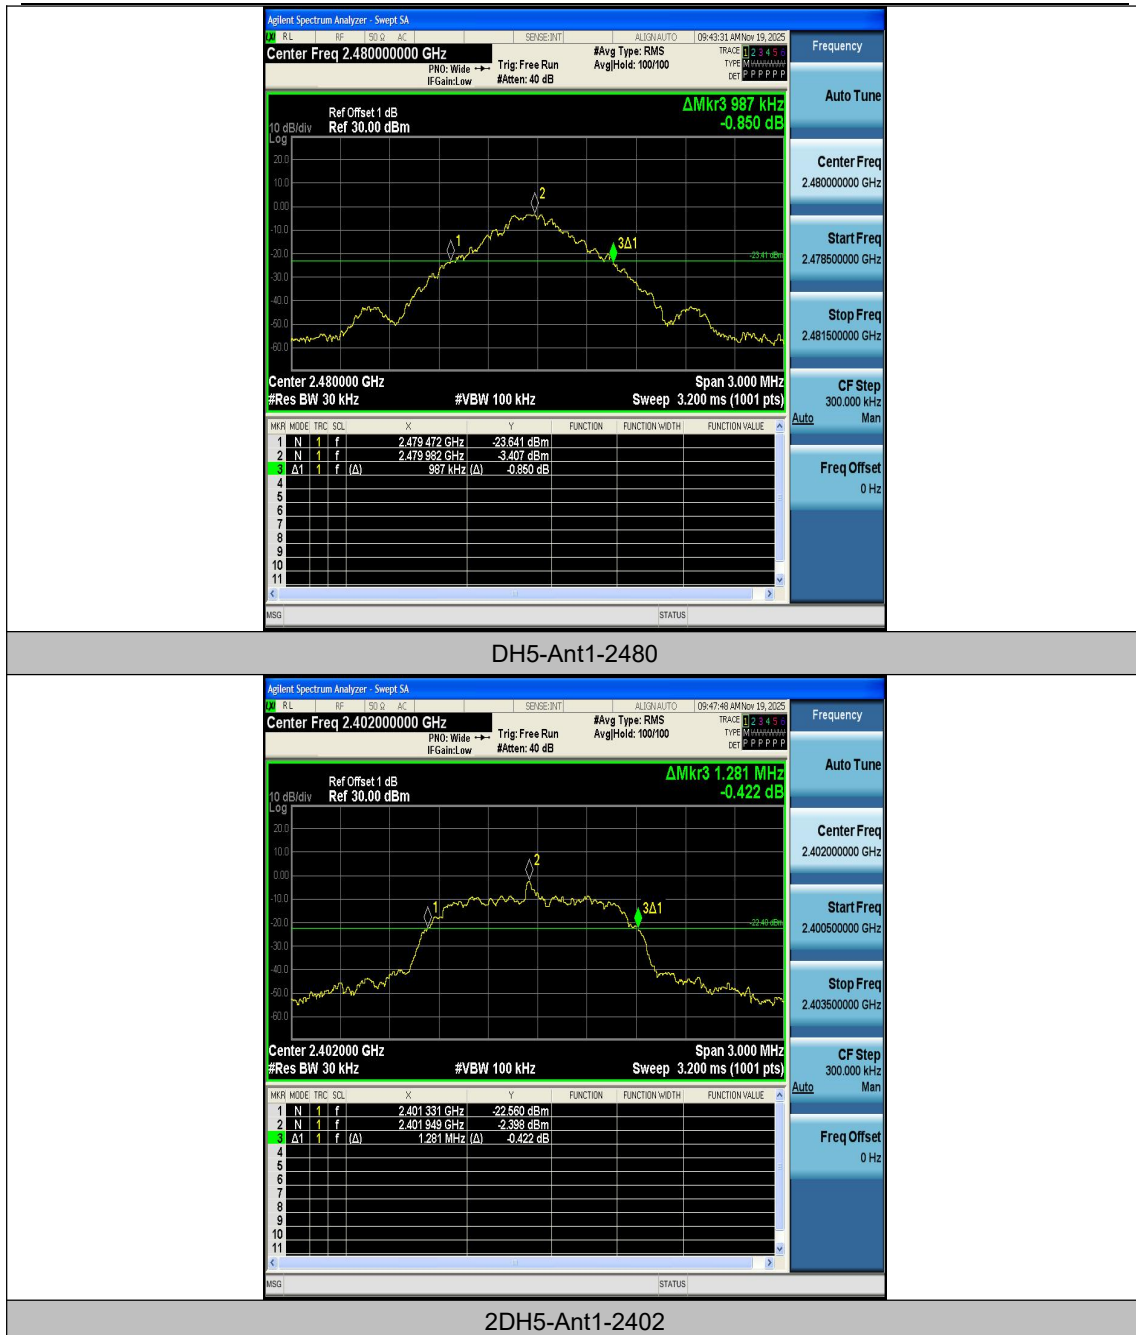


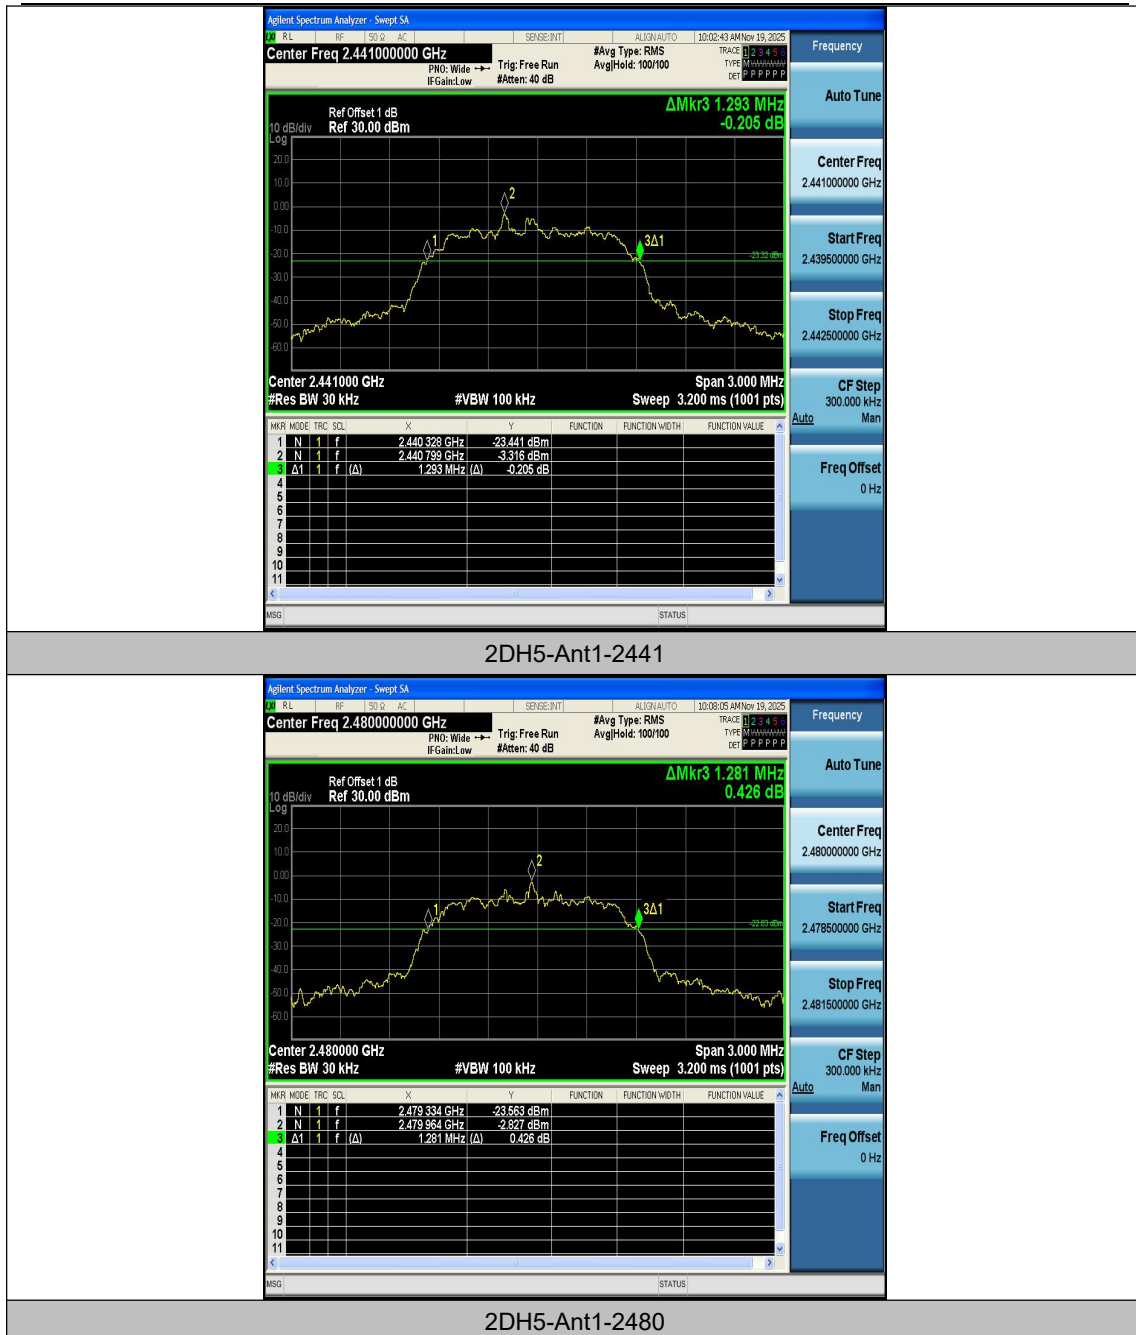

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

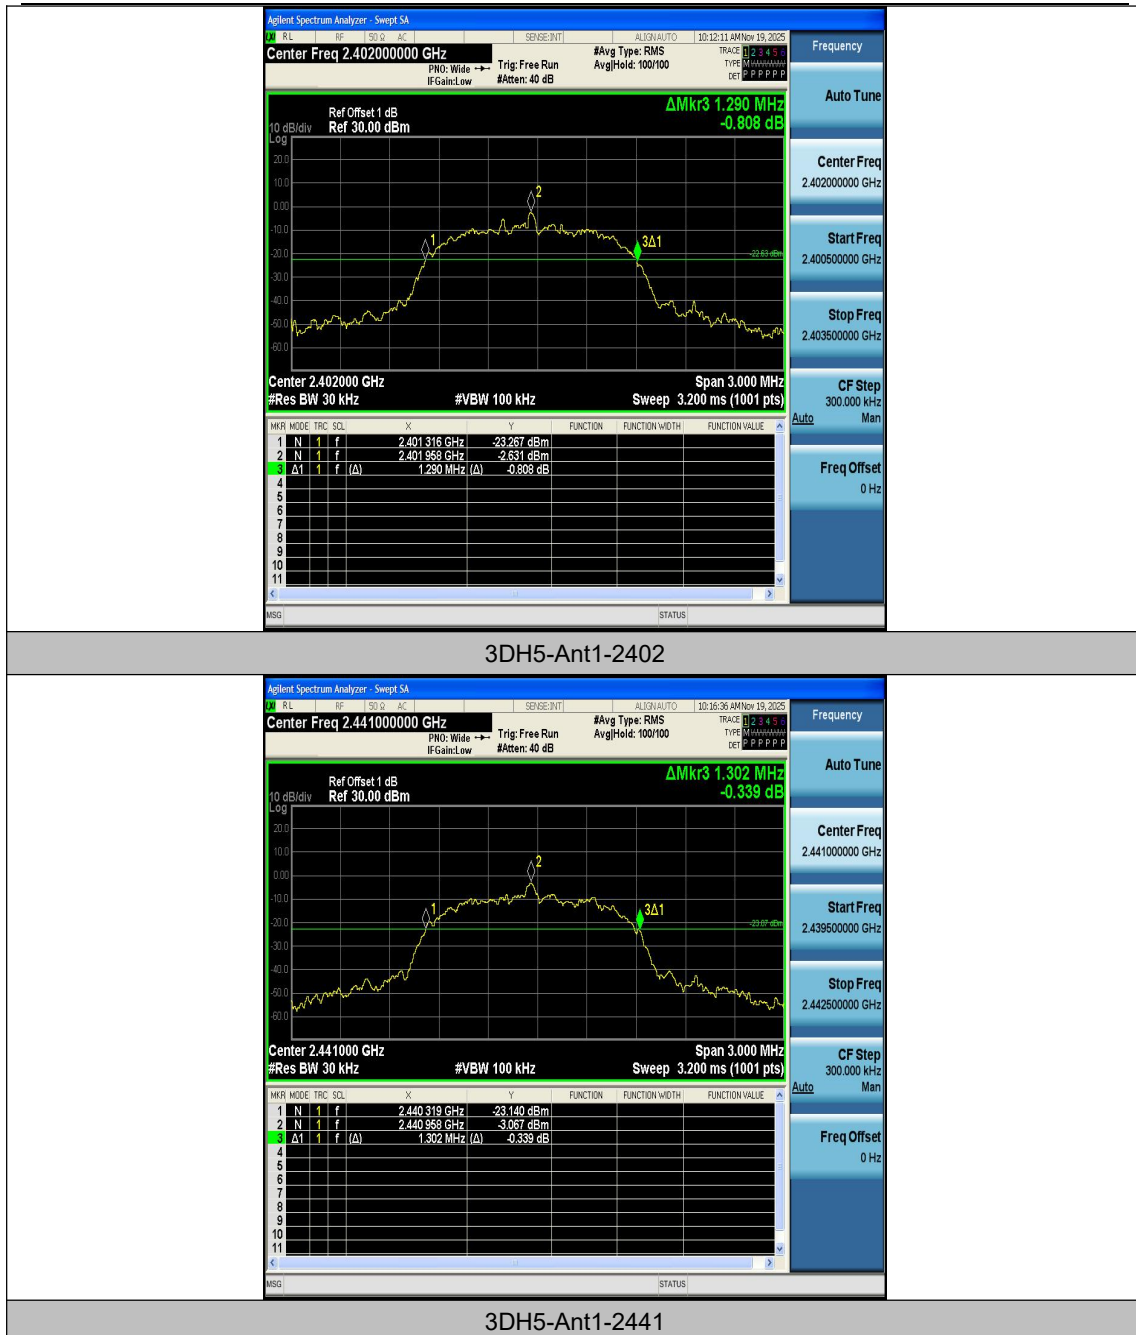

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	0.87480	2401.5186	2402.3934	---	---
DH5	Ant1	2441	0.86108	2440.5235	2441.3846	---	---
DH5	Ant1	2480	0.89343	2479.5185	2480.4119	---	---
2DH5	Ant1	2402	1.1939	2401.3692	2402.5631	---	---
2DH5	Ant1	2441	1.1879	2440.3701	2441.5580	---	---
2DH5	Ant1	2480	1.1847	2479.3728	2480.5575	---	---
3DH5	Ant1	2402	1.1800	2401.3725	2402.5525	---	---
3DH5	Ant1	2441	1.1839	2440.3771	2441.5610	---	---
3DH5	Ant1	2480	1.1881	2479.3777	2480.5658	---	---


Test Graphs



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

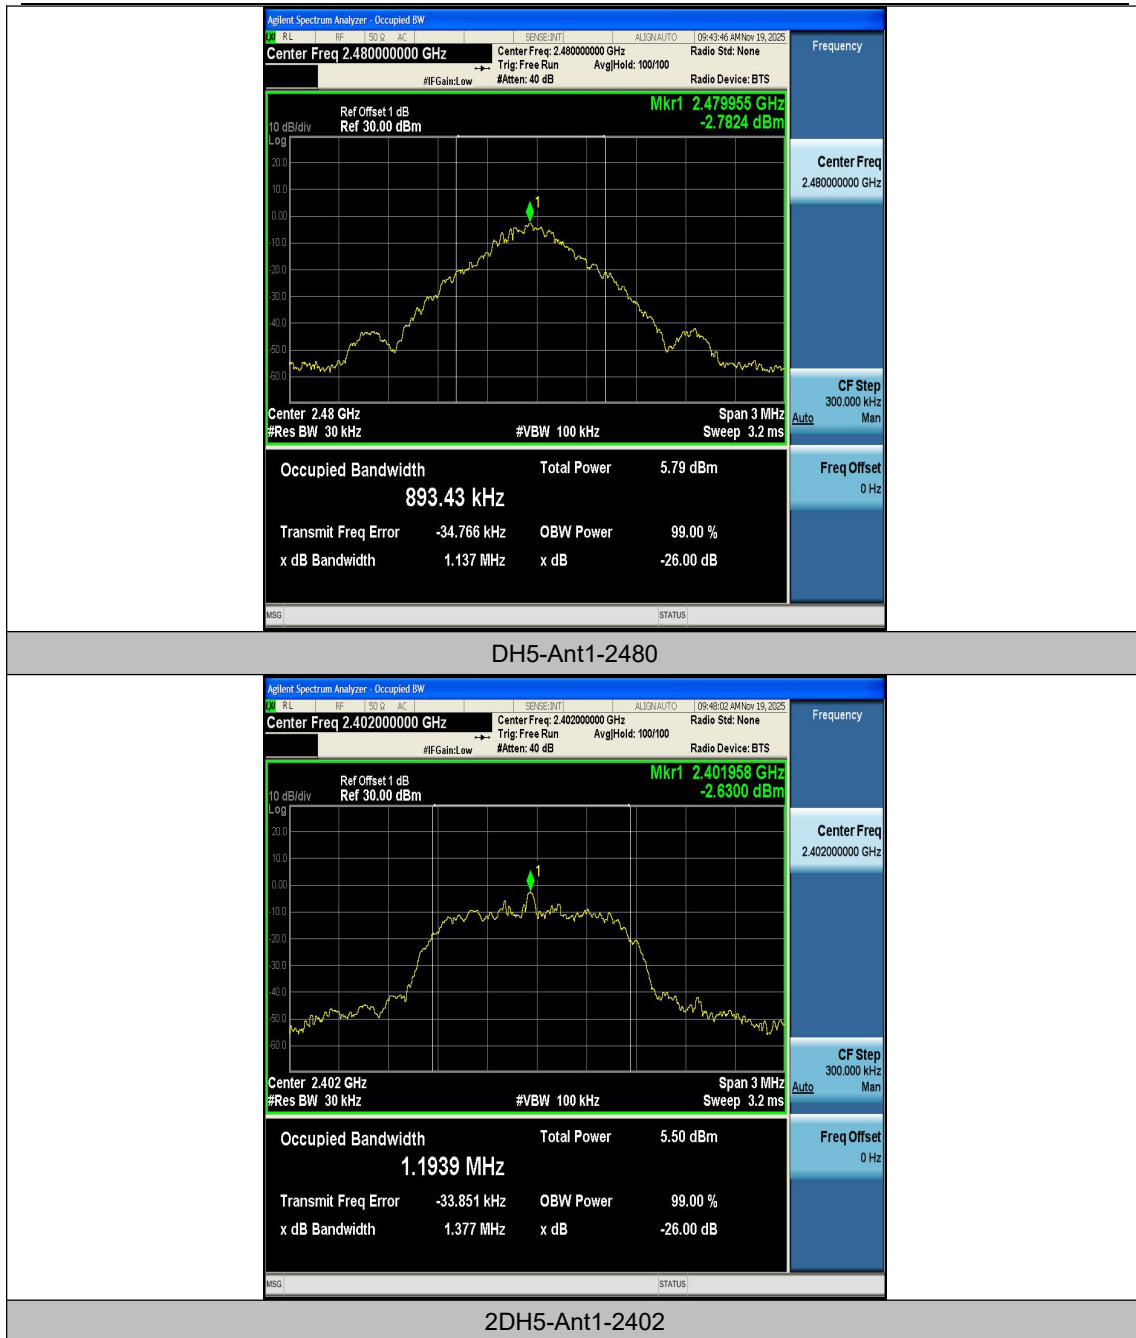

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

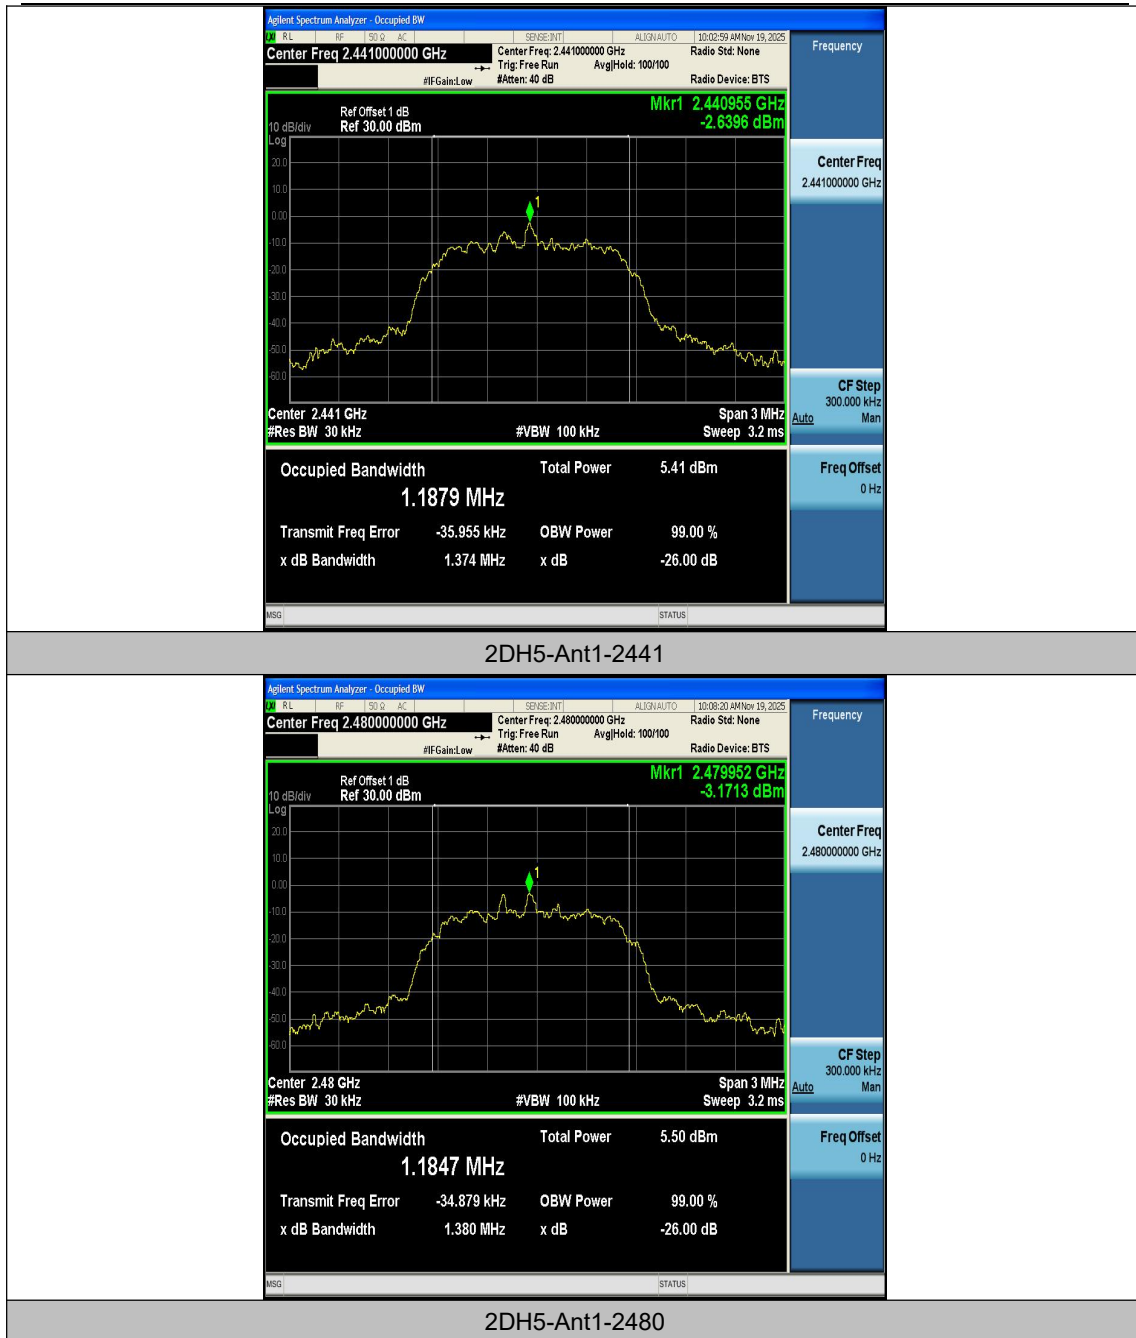

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

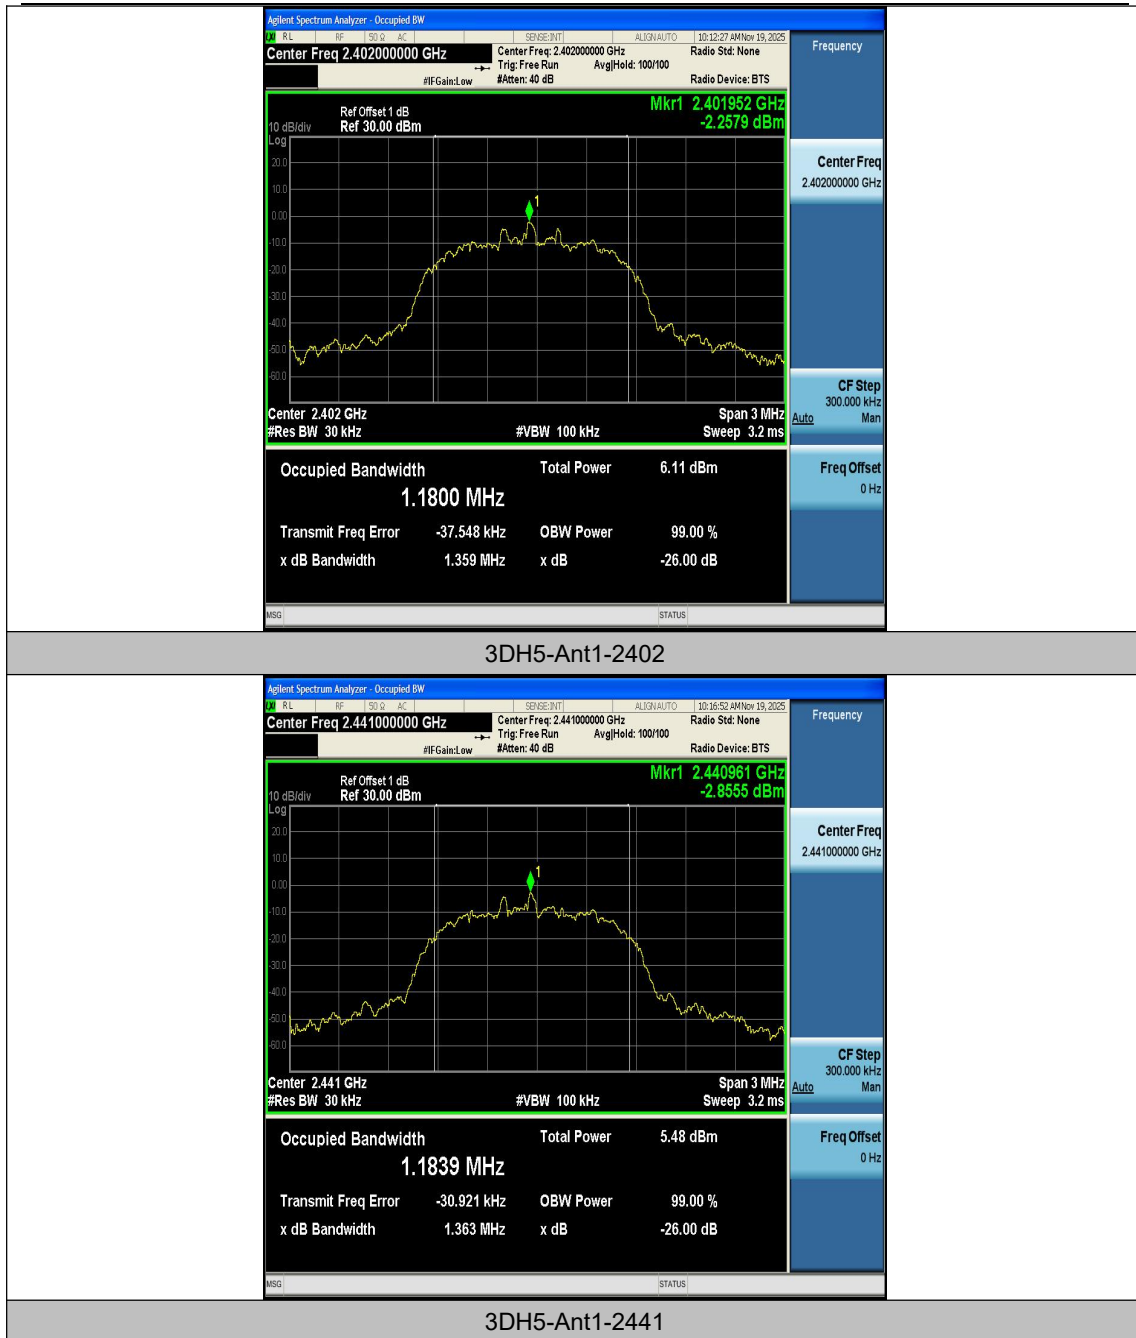

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix C: Maximum Conducted Output Power

Test Result Peak

Test Mode	Antenna	Frequency[MHz]	Conducted Peak Power[dBm]	Conducted Limit[dBm]	Verdict
DH5	Ant1	2402	-0.43	≤20.97	PASS
DH5	Ant1	2441	-0.78	≤20.97	PASS
DH5	Ant1	2480	-0.71	≤20.97	PASS
2DH5	Ant1	2402	0.32	≤20.97	PASS
2DH5	Ant1	2441	0.08	≤20.97	PASS
2DH5	Ant1	2480	0.16	≤20.97	PASS
3DH5	Ant1	2402	0.73	≤20.97	PASS
3DH5	Ant1	2441	0.40	≤20.97	PASS
3DH5	Ant1	2480	0.52	≤20.97	PASS

Test Graphs




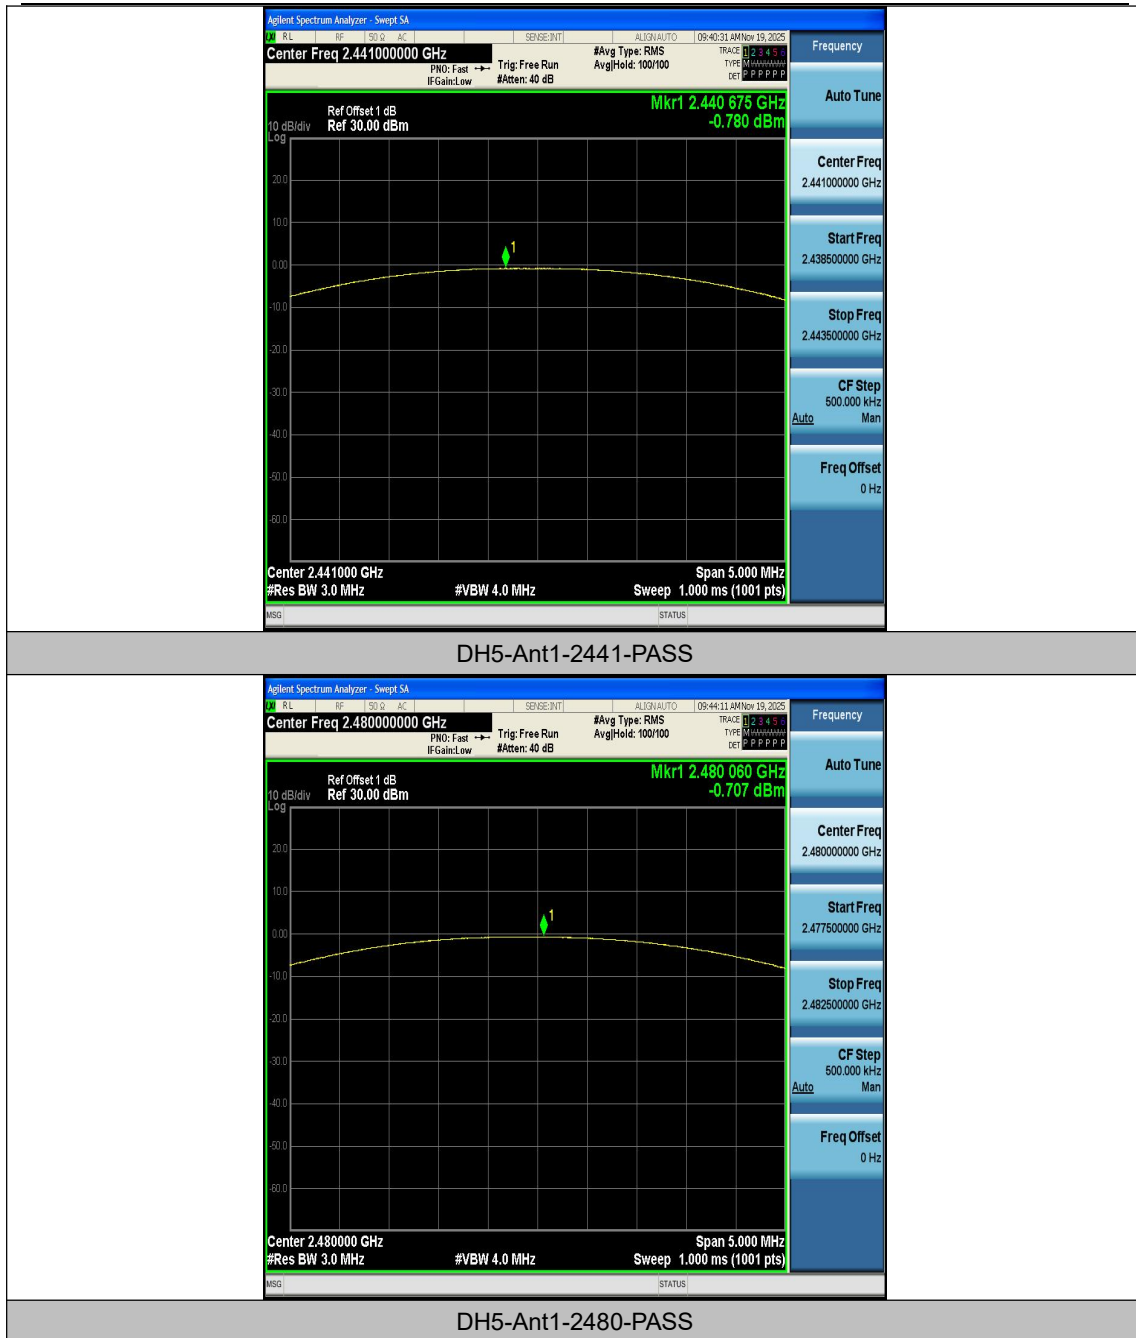

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

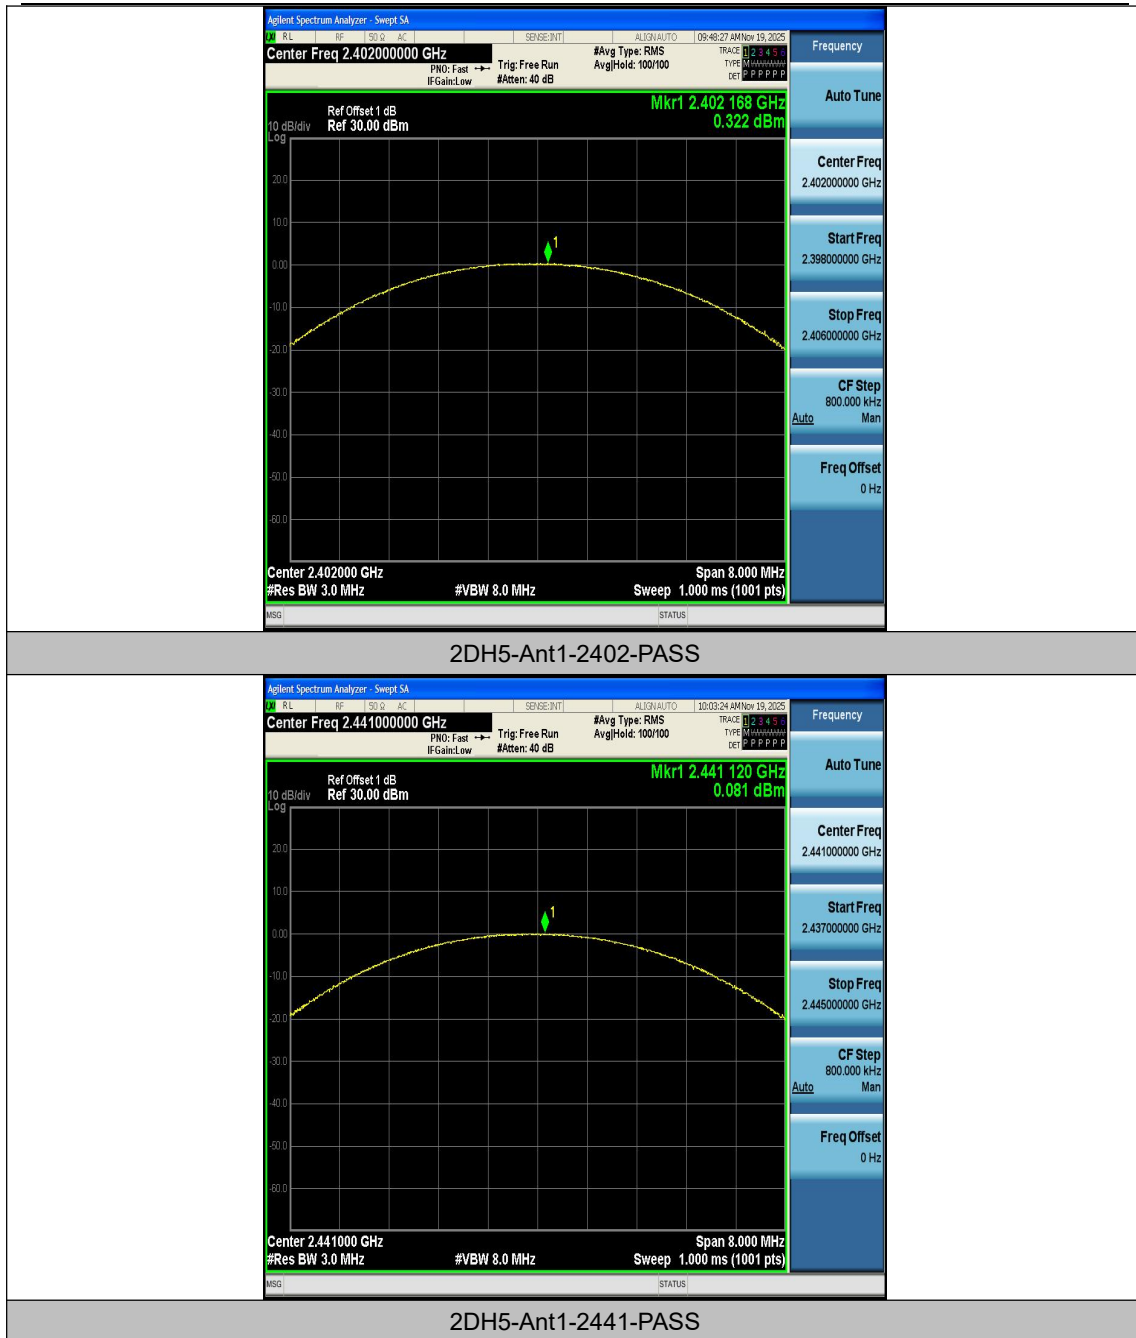

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

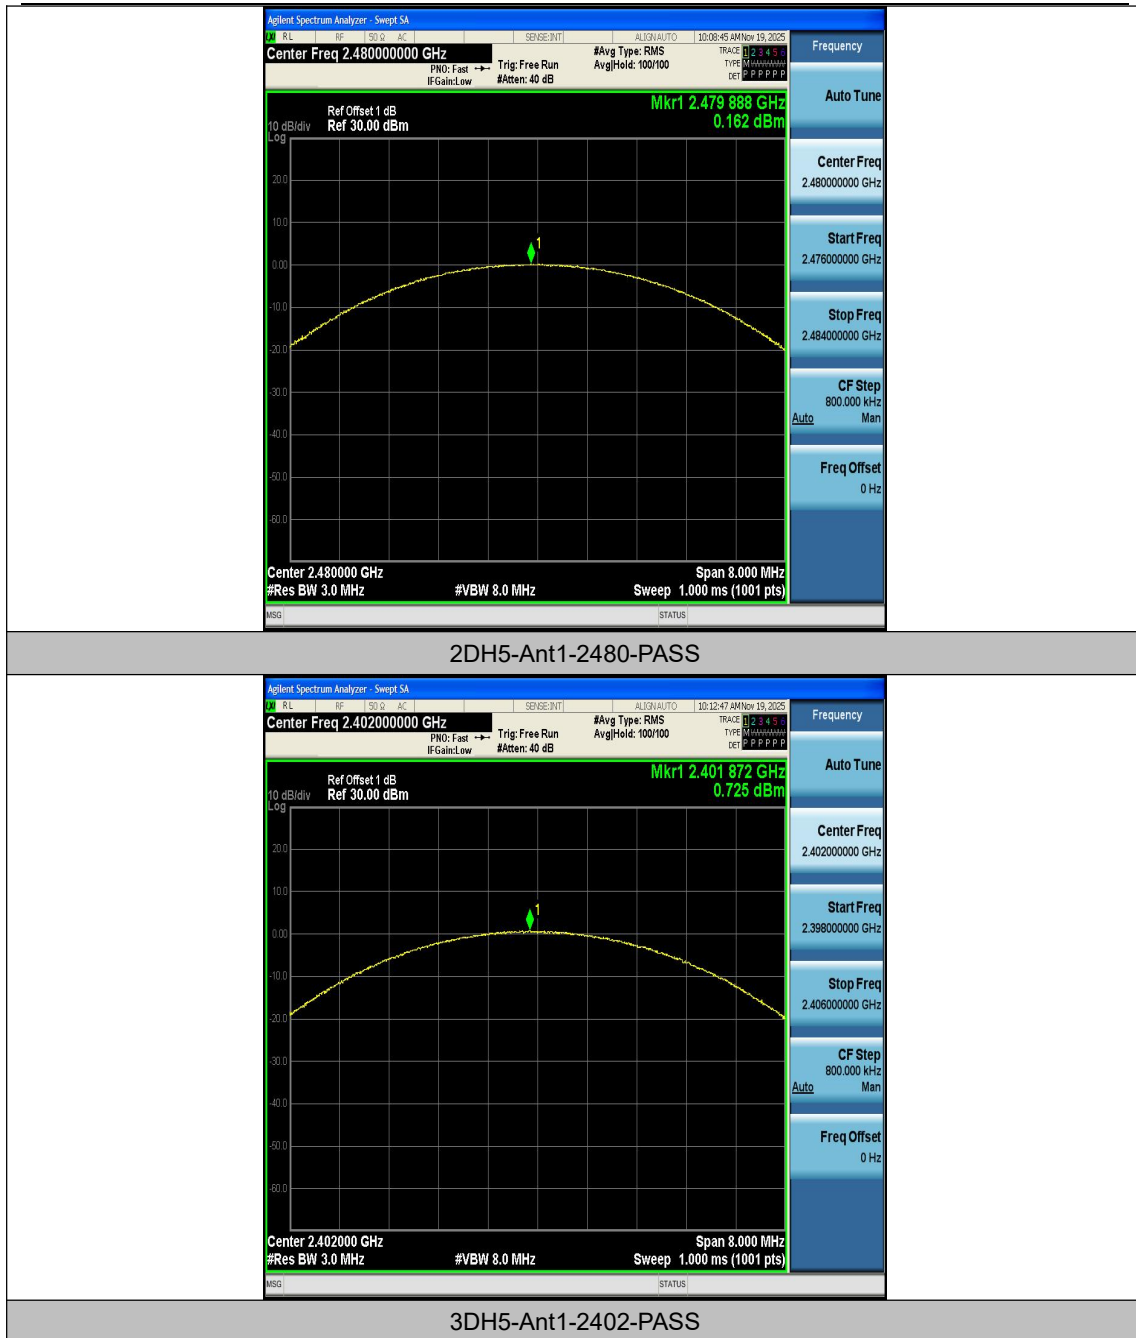

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

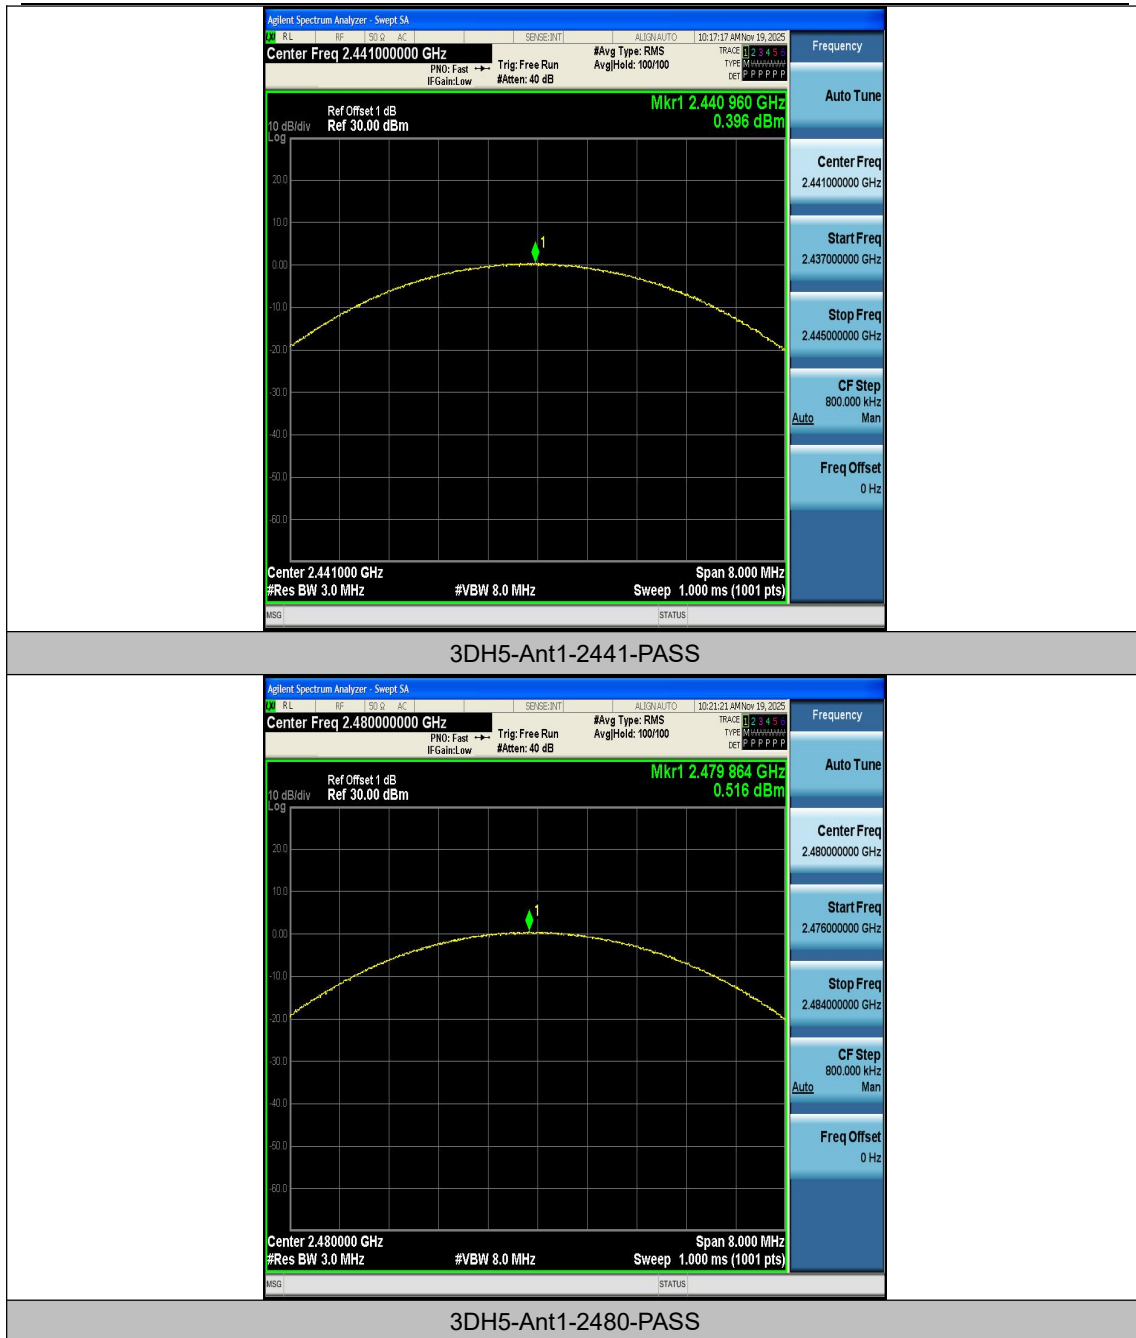

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Carrier frequency separation

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [MHz]	Limit[MHz]	Verdict
DH5	Ant1	Hop	1.168	≥ 0.996	PASS
2DH5	Ant1	Hop	1.004	≥ 0.862	PASS
3DH5	Ant1	Hop	1.03	≥ 0.872	PASS


Test Graphs

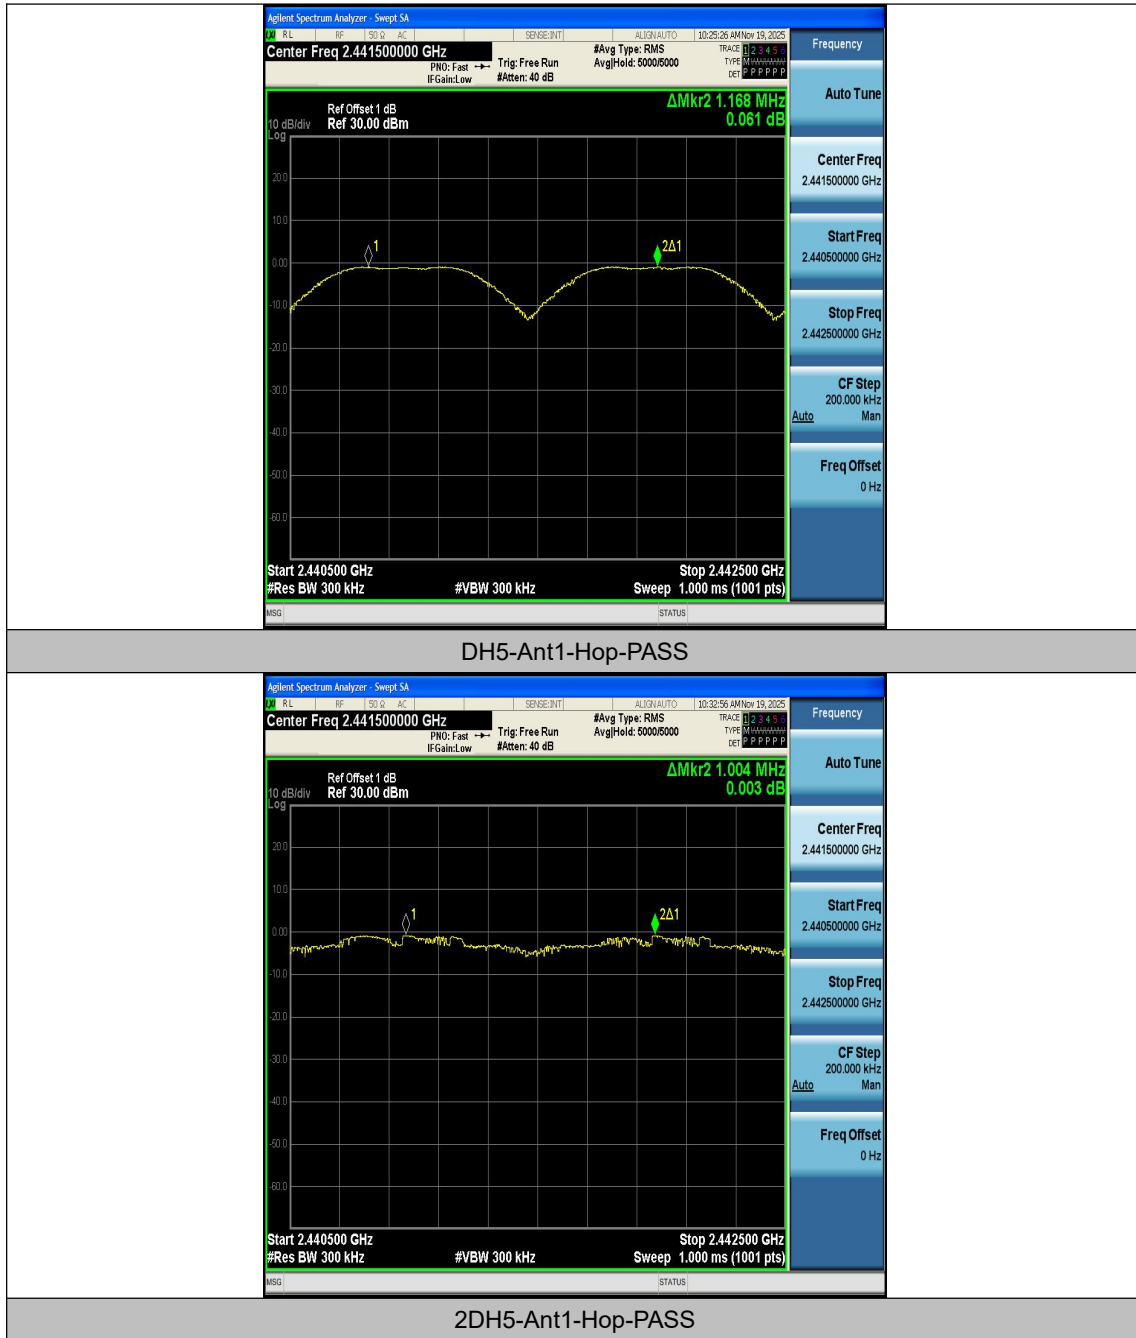

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

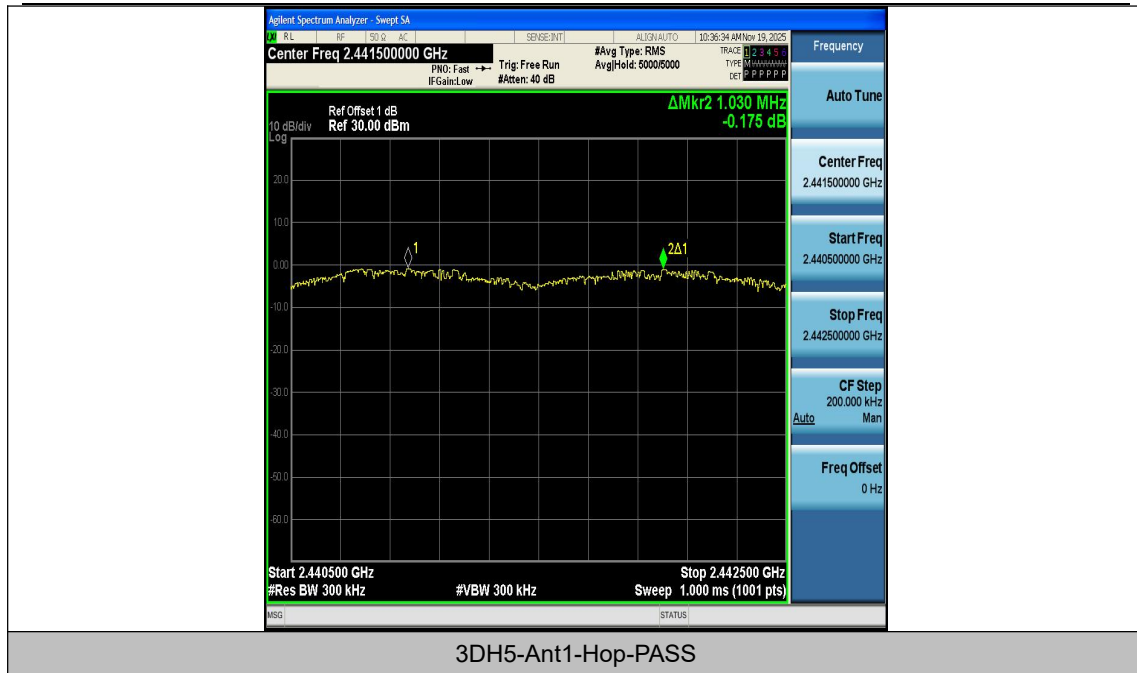

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com