



NVNT	ac20	5180	Ant2	5148.2	-42.29	2.26	-	55.20	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5148.9	-56.02	2.26	0.12	41.59	Average	54	Pass
NVNT	ac20	5180	Ant2	5150	-46.23	2.26	-	51.26	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5150	-55.97	2.26	0.12	41.64	Average	54	Pass
NVNT	ac20	5240	Ant2	5350	-49.4	2.26	-	48.09	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350	-58.78	2.26	0.12	38.83	Average	54	Pass
NVNT	ac20	5240	Ant2	5430.96	-47.2	2.26	-	50.29	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5386.8	-57.19	2.26	0.12	40.42	Average	54	Pass
NVNT	ac20	5240	Ant2	5460	-49.45	2.26	-	48.04	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5460	-58.31	2.26	0.12	39.30	Average	54	Pass
NVNT	ac40	5190	Ant2	4500	-51.01	2.26	-	46.48	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4500	-58.45	2.26	0.24	39.28	Average	54	Pass
NVNT	ac40	5190	Ant2	5149.7	-36.64	2.26	-	60.85	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5148.97	-55.2	2.26	0.24	42.53	Average	54	Pass
NVNT	ac40	5190	Ant2	5150	-36.64	2.26	-	60.85	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5150	-55.45	2.26	0.24	42.28	Average	54	Pass
NVNT	ac40	5230	Ant2	5350	-50.3	2.26	-	47.19	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350	-58.17	2.26	0.24	39.56	Average	54	Pass
NVNT	ac40	5230	Ant2	5382.78	-47.33	2.26	-	50.16	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5385.21	-57.51	2.26	0.24	40.22	Average	54	Pass
NVNT	ac40	5230	Ant2	5460	-49.15	2.26	-	48.34	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5460	-58.28	2.26	0.24	39.45	Average	54	Pass
NVNT	ac80	5210	Ant2	5350	-47.44	2.26	-	50.05	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350	-56.62	2.26	0.47	41.34	Average	54	Pass
NVNT	ac80	5210	Ant2	5362.65	-45.47	2.26	-	52.02	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350.77	-56.38	2.26	0.47	41.58	Average	54	Pass
NVNT	ac80	5210	Ant2	5460	-50.34	2.26	-	47.15	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5460	-57.85	2.26	0.47	40.11	Average	54	Pass
NVNT	ac80	5210	Ant2	4500	-51.19	2.26	-	46.30	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	4500	-58.87	2.26	0.47	39.09	Average	54	Pass
NVNT	ac80	5210	Ant2	5148.59	-43.95	2.26	-	53.54	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5147.8	-55.45	2.26	0.47	42.51	Average	54	Pass
NVNT	ac80	5210	Ant2	5150	-46.43	2.26	-	51.06	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5150	-55.45	2.26	0.47	42.51	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant2 Peak

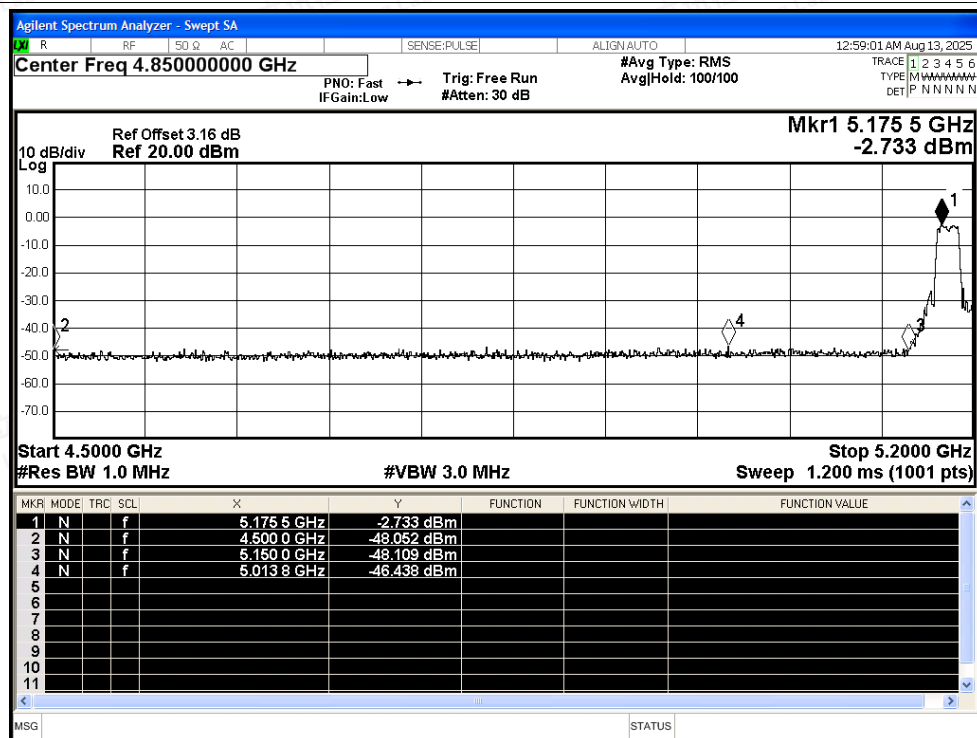

Restrict Band NVNT a 5180MHz Ant2 Average

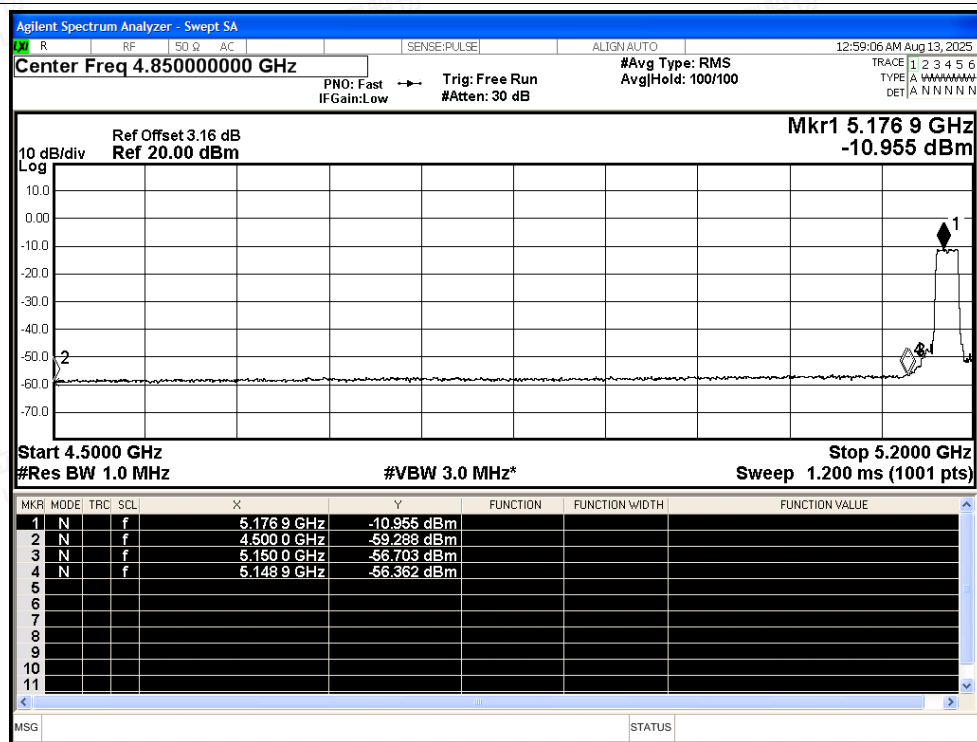

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant2 Peak

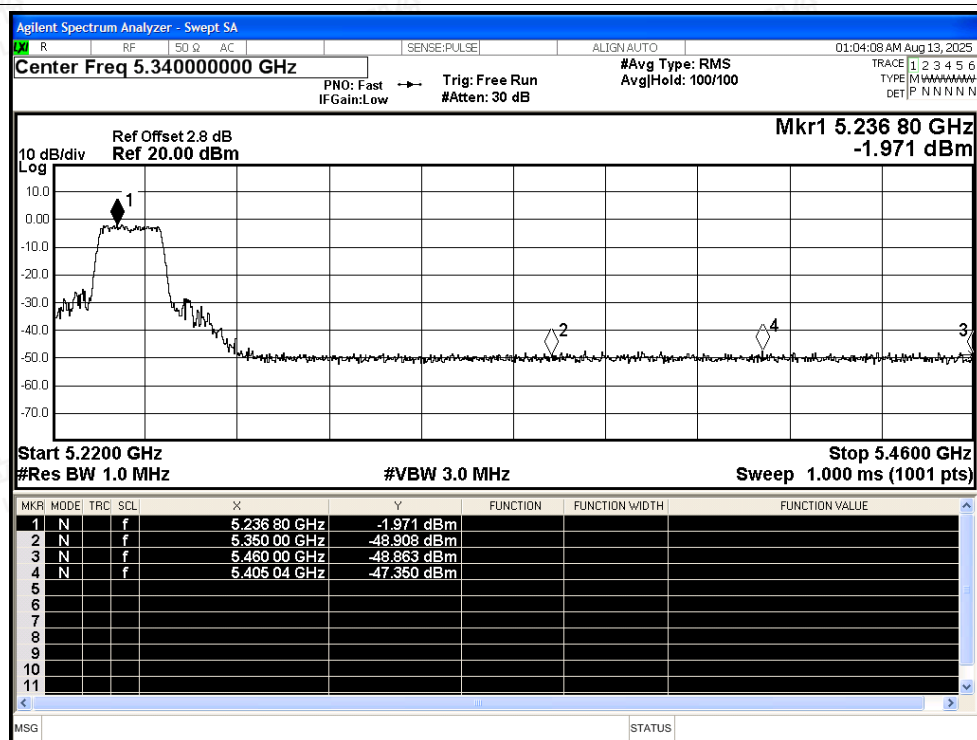

Restrict Band NVNT a 5240MHz Ant2 Average

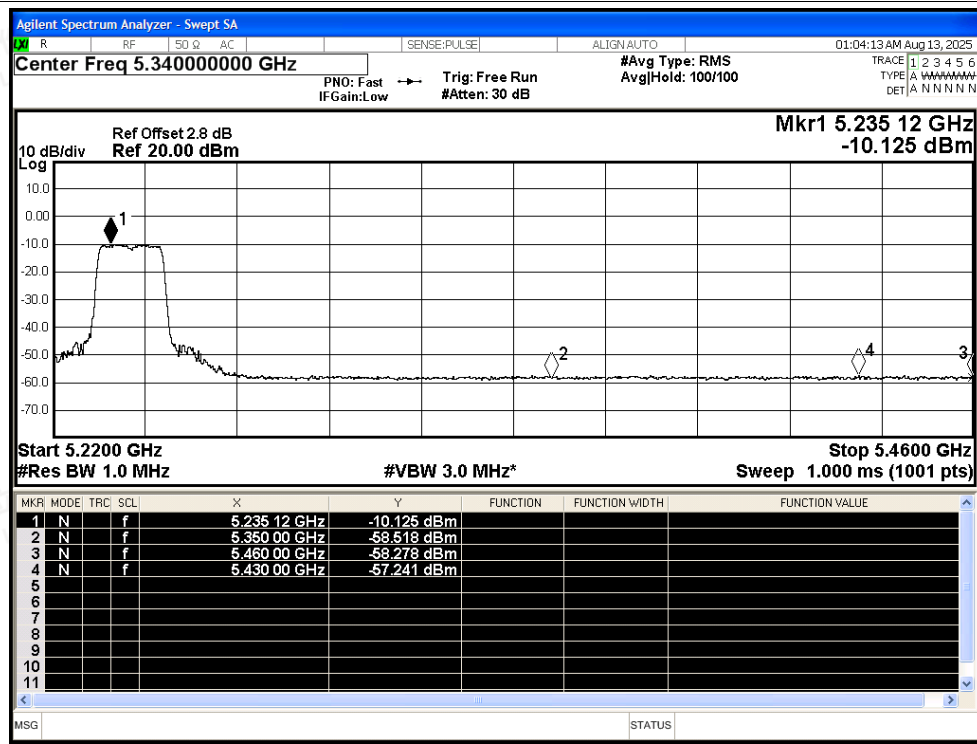

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant2 Peak

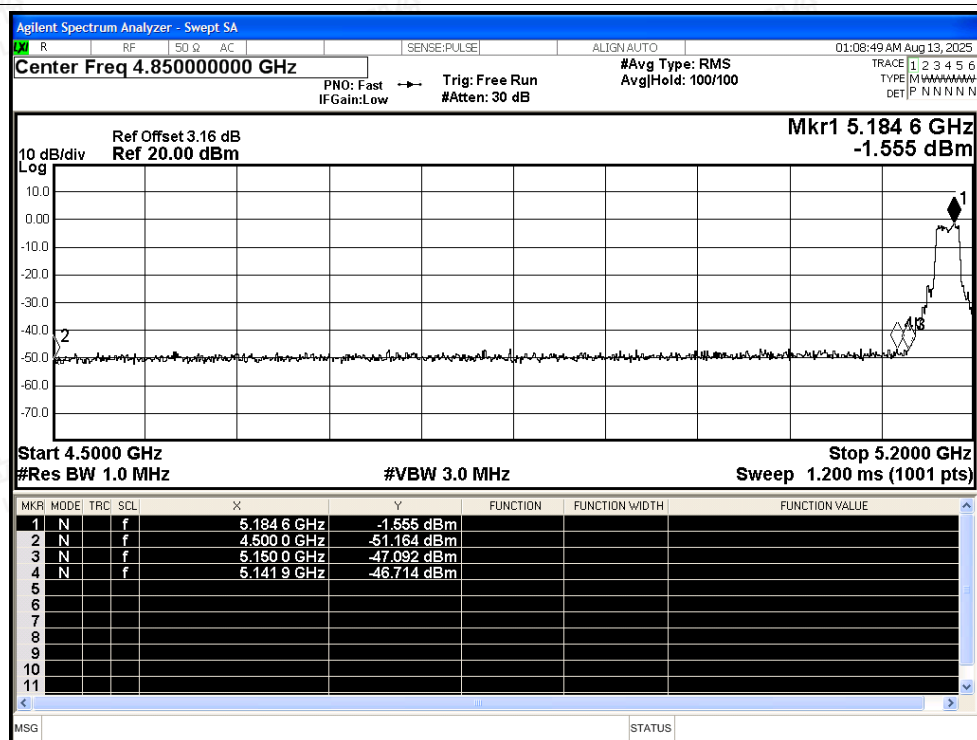

Restrict Band NVNT n20 5180MHz Ant2 Average

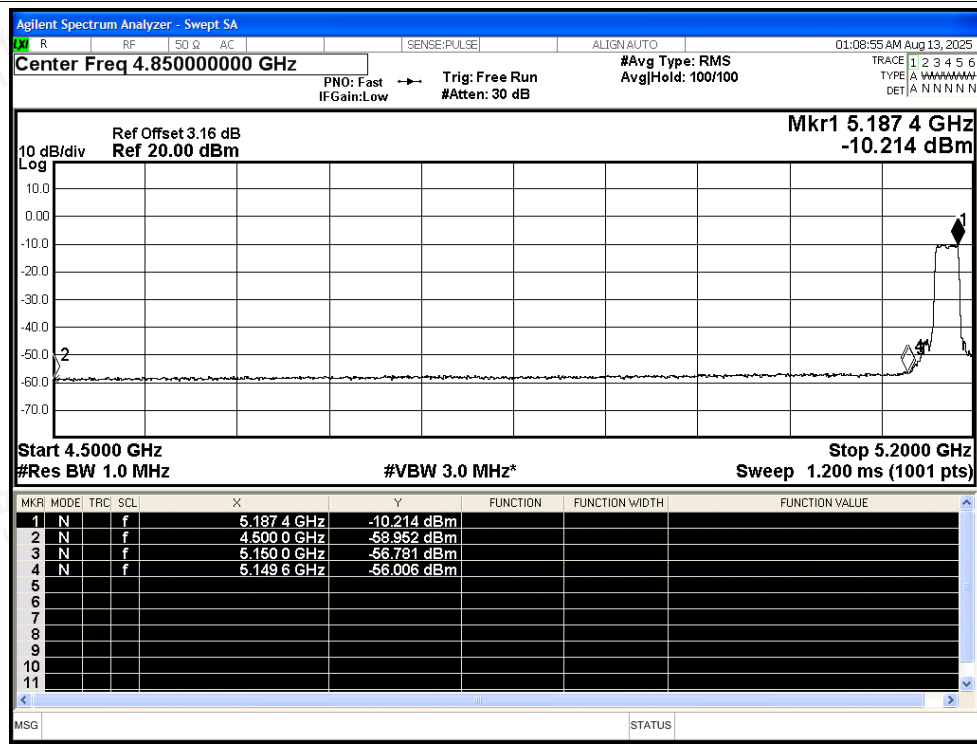

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant2 Peak

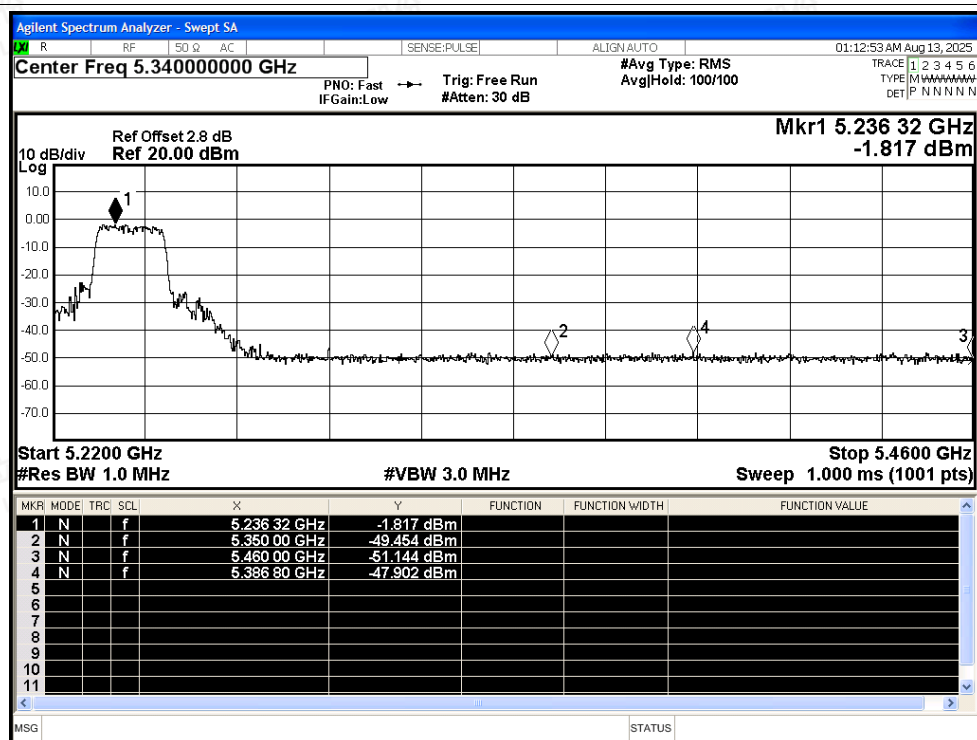

Restrict Band NVNT n20 5240MHz Ant2 Average

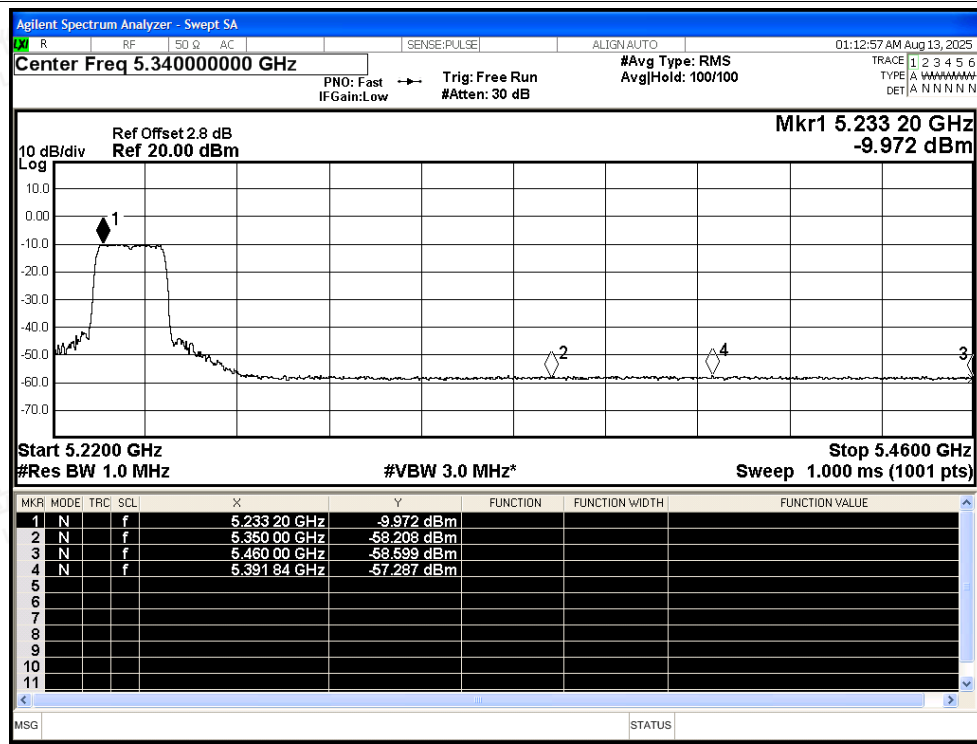

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant2 Peak

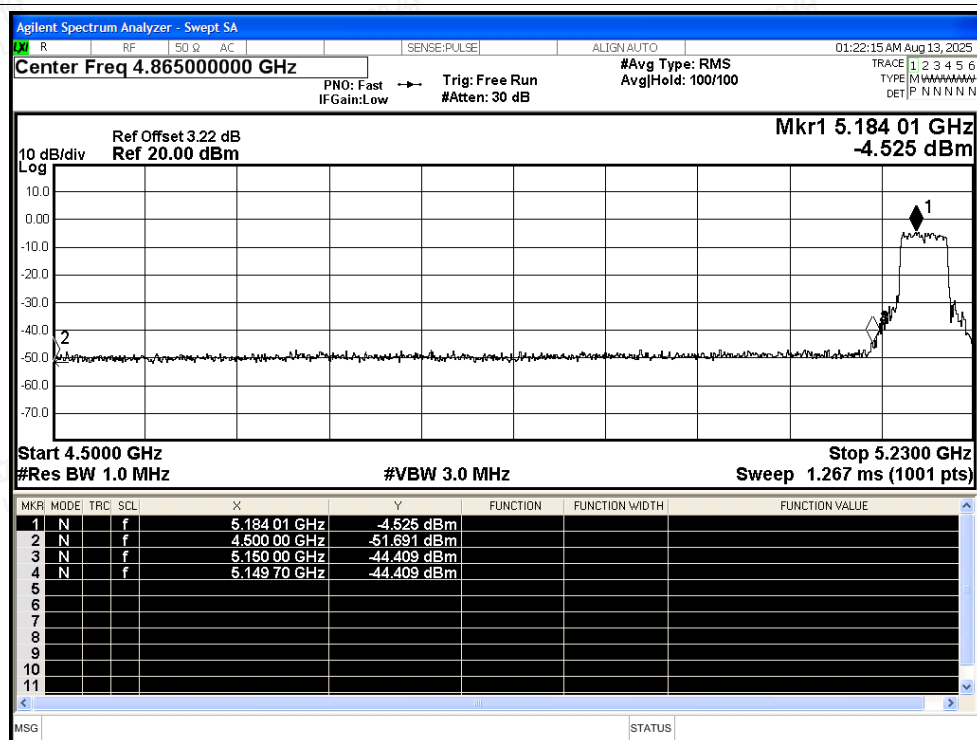

Restrict Band NVNT n40 5190MHz Ant2 Average

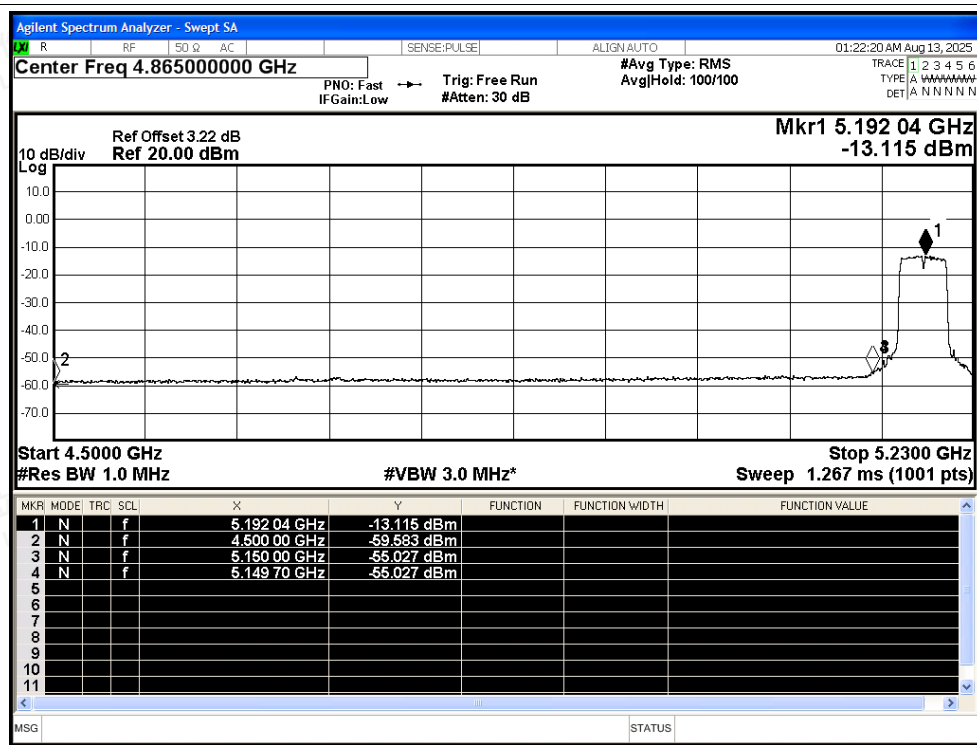

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant2 Peak

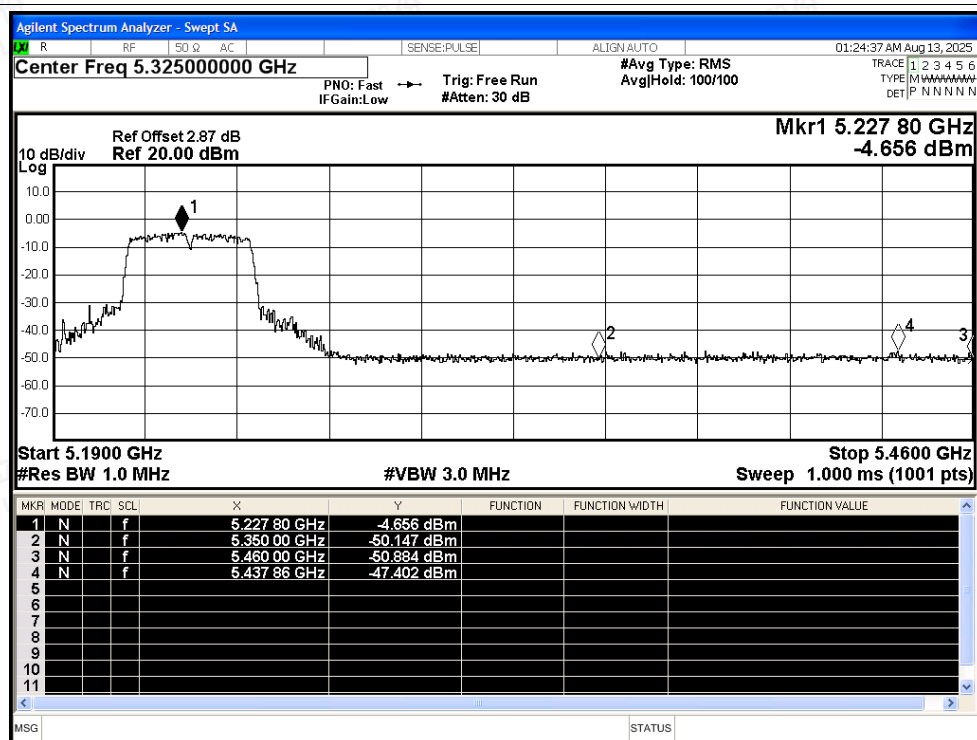

Restrict Band NVNT n40 5230MHz Ant2 Average

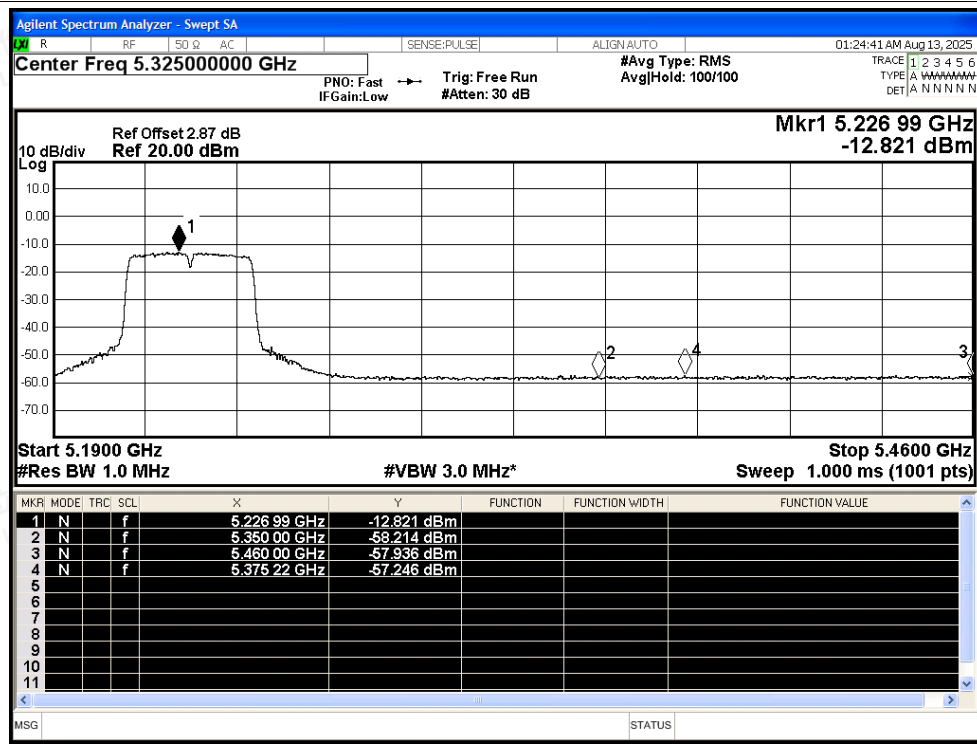

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant2 Peak

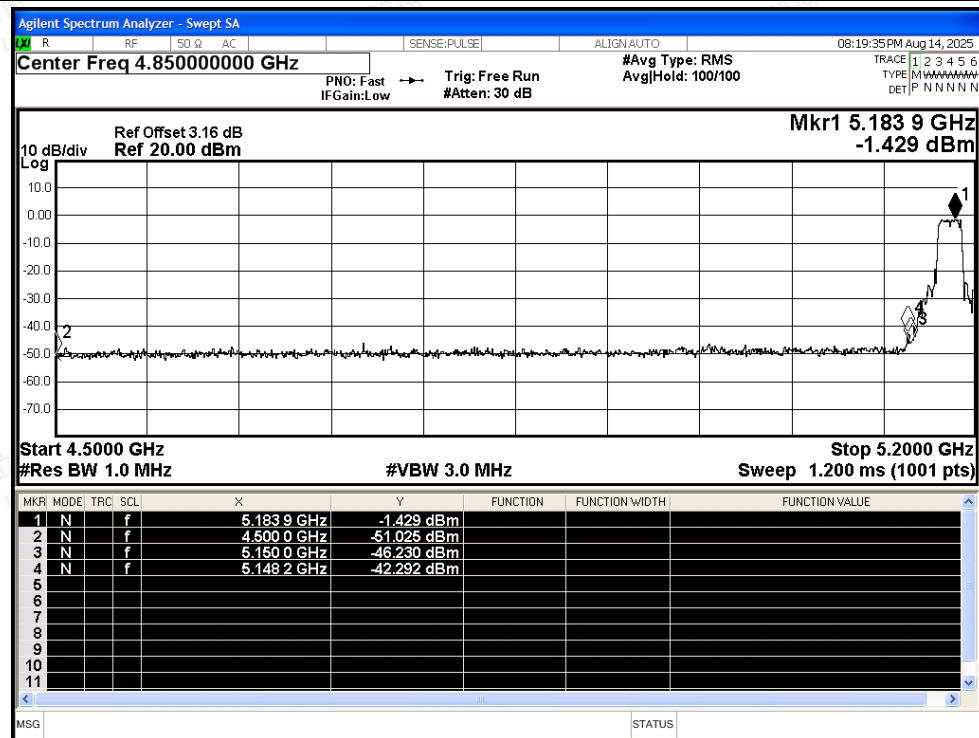

Restrict Band NVNT ac20 5180MHz Ant2 Average

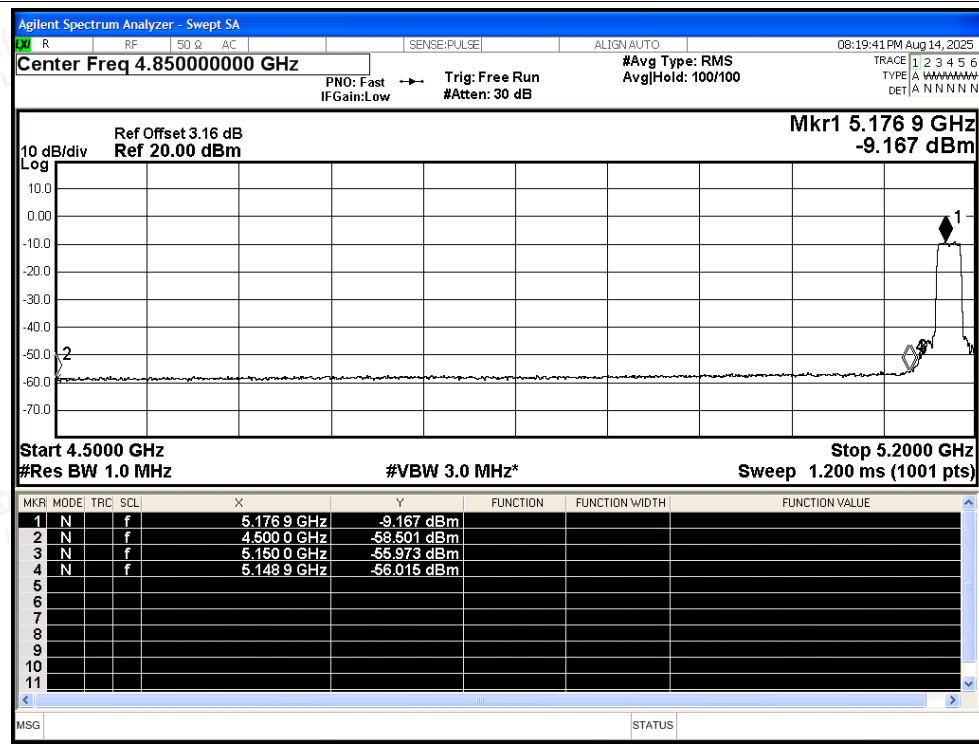

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant2 Peak

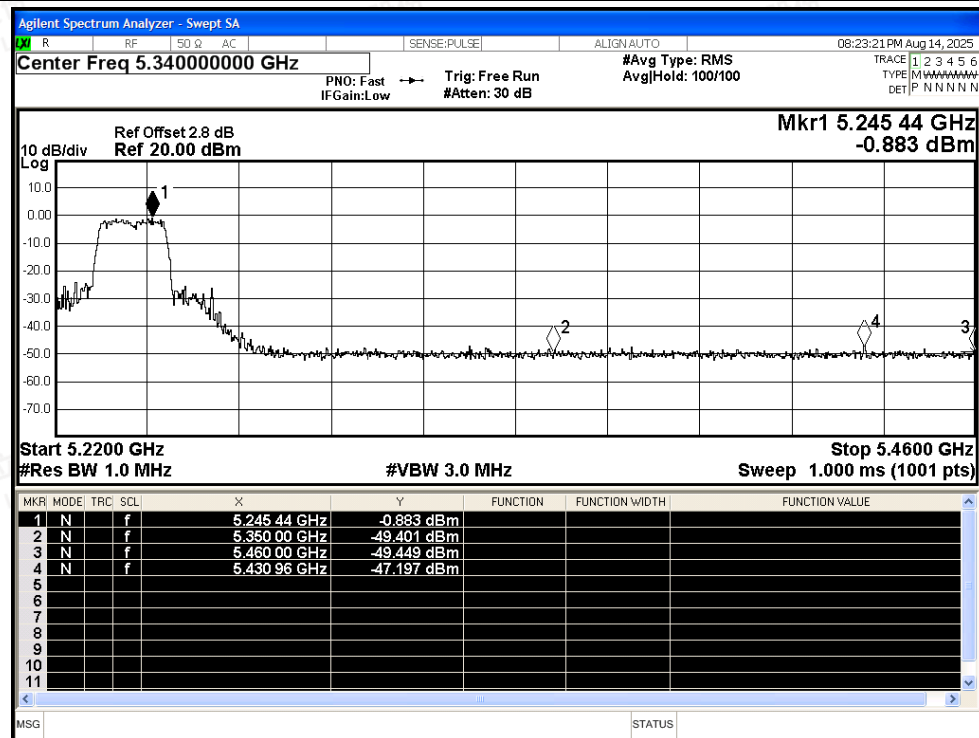

Restrict Band NVNT ac20 5240MHz Ant2 Average

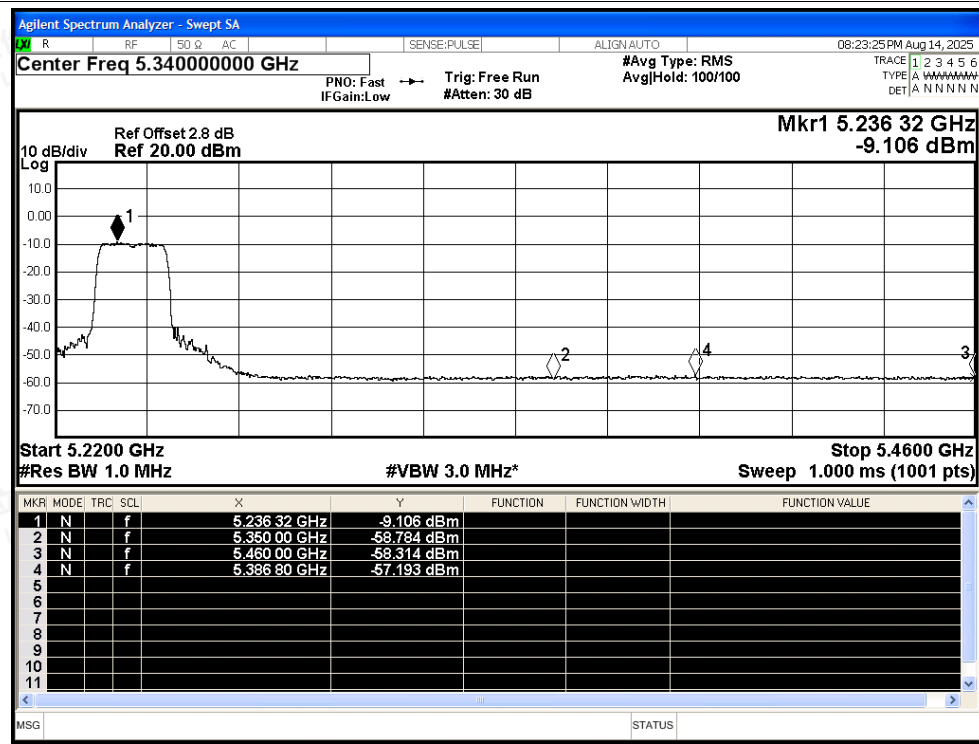

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant2 Peak

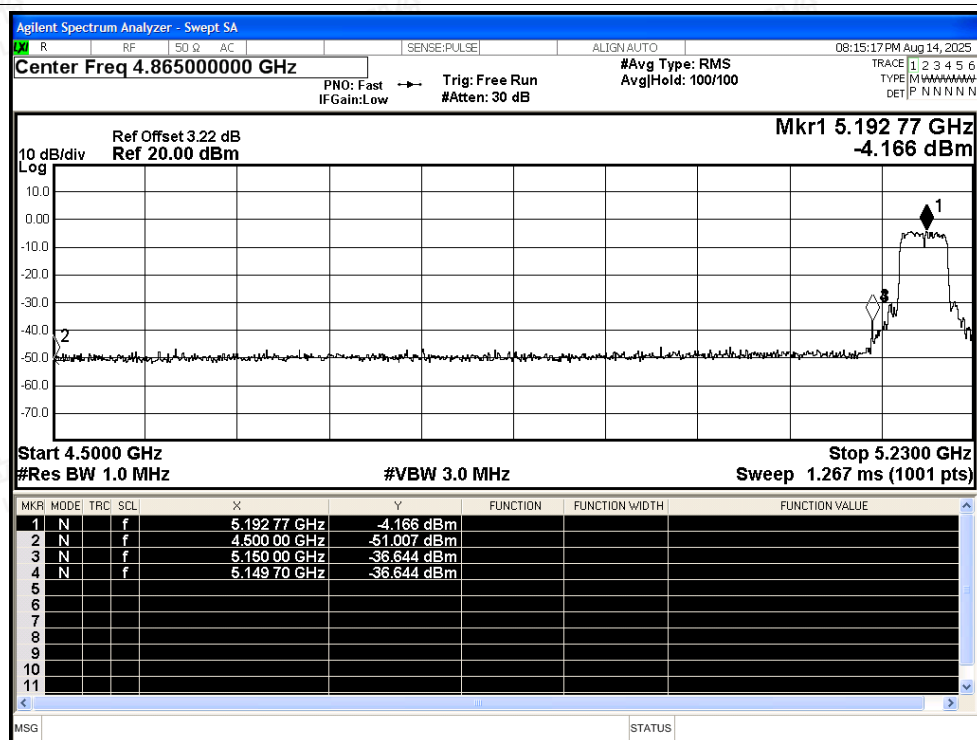

Restrict Band NVNT ac40 5190MHz Ant2 Average

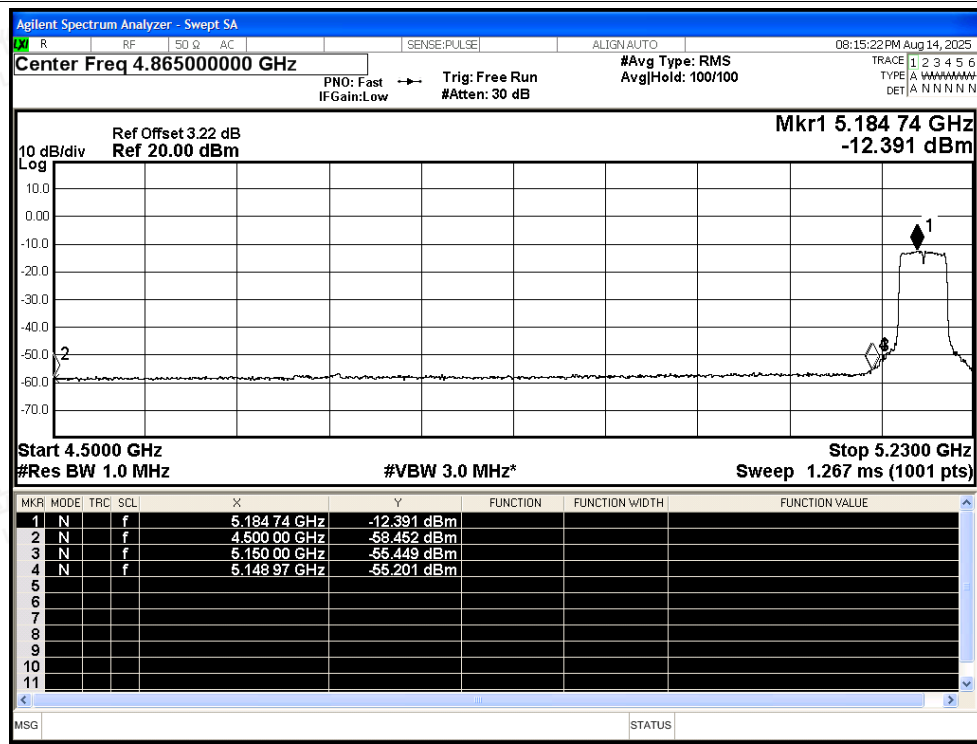

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant2 Peak

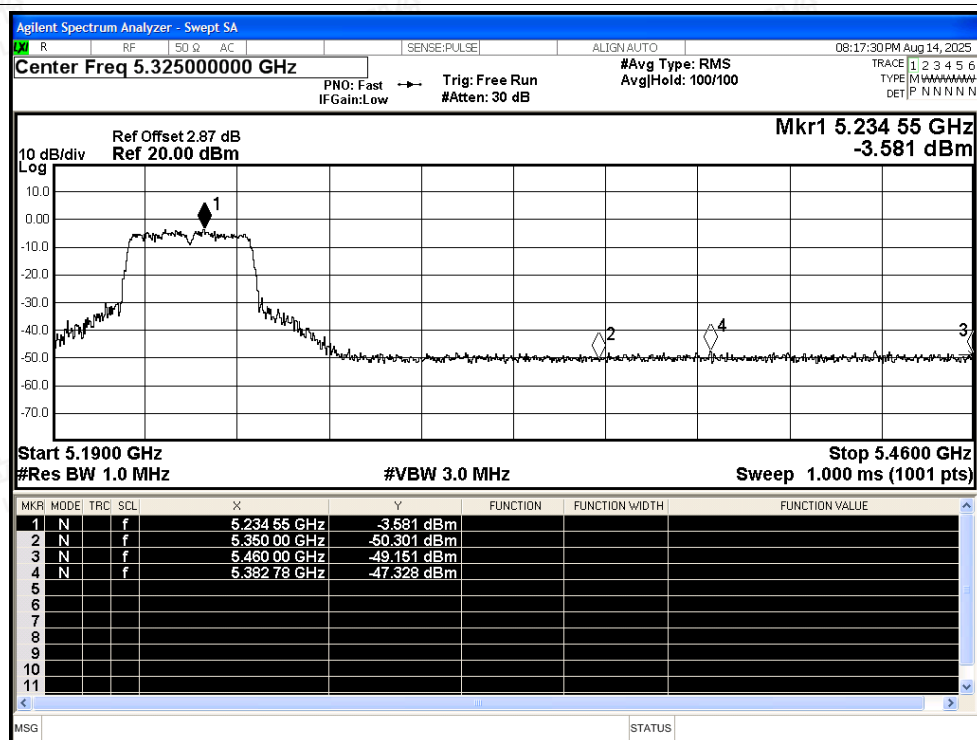

Restrict Band NVNT ac40 5230MHz Ant2 Average

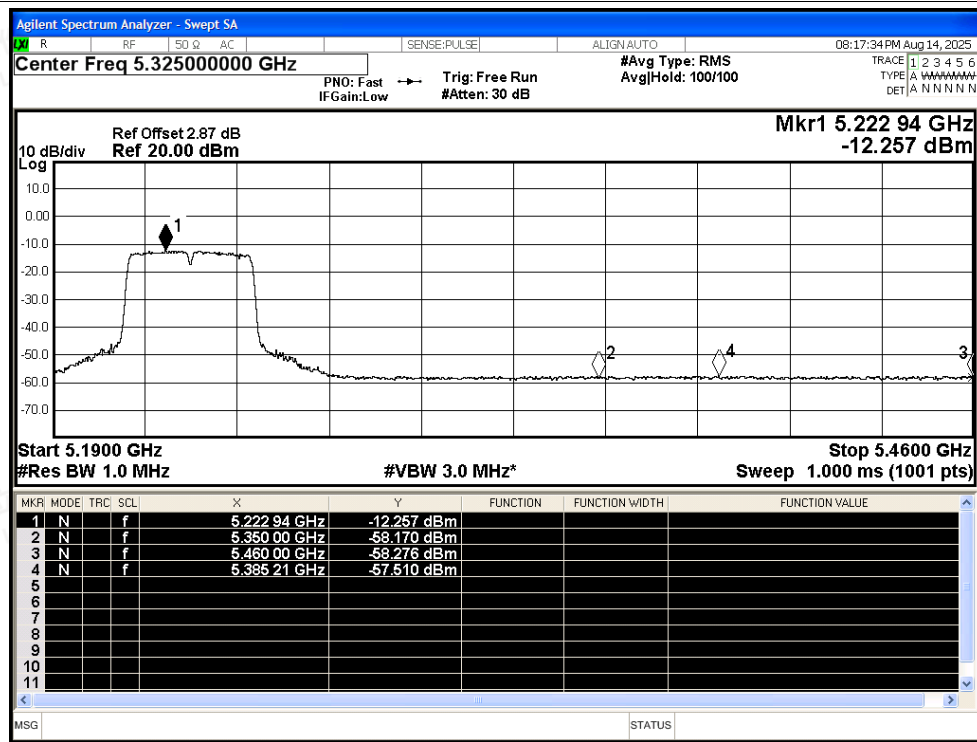

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant2 Peak

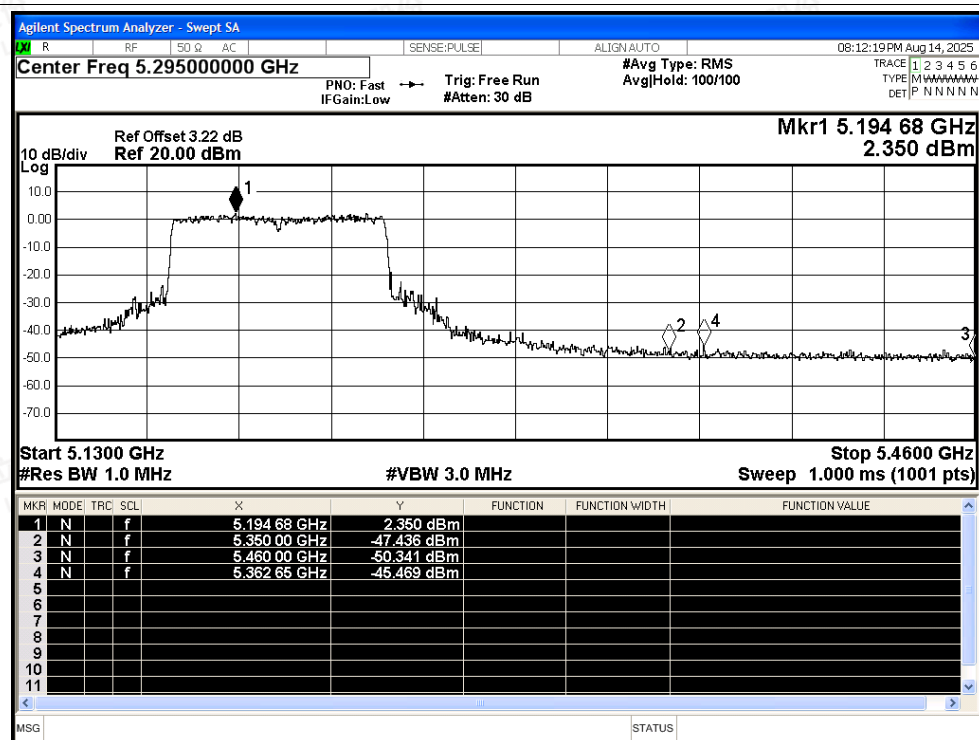

Restrict Band NVNT ac80 5210MHz Ant2 Average

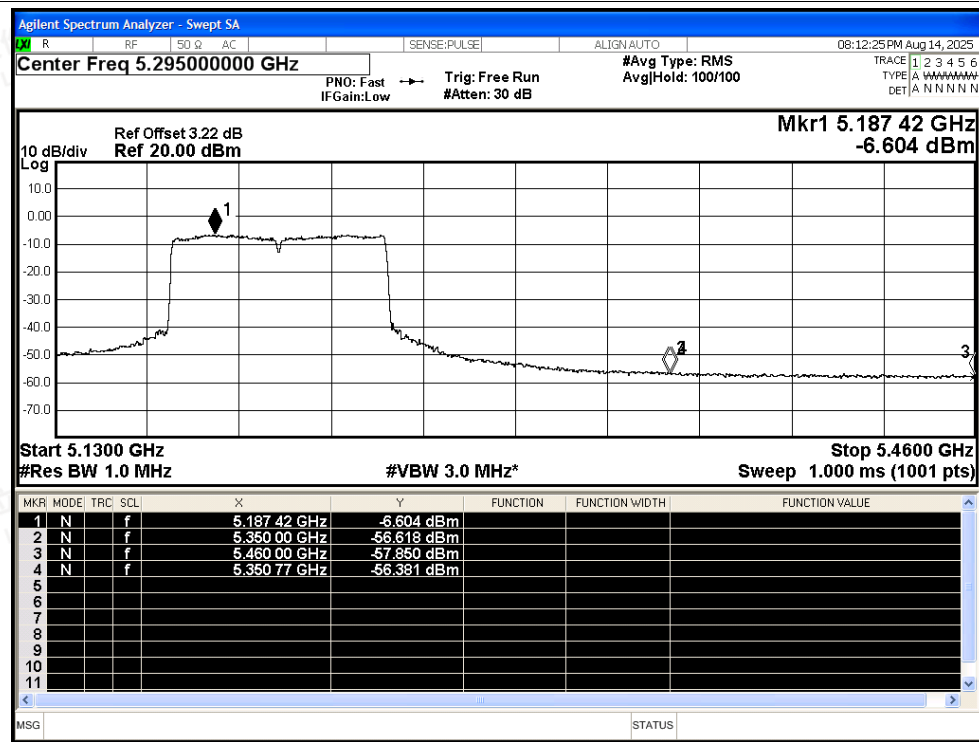

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant2 Peak

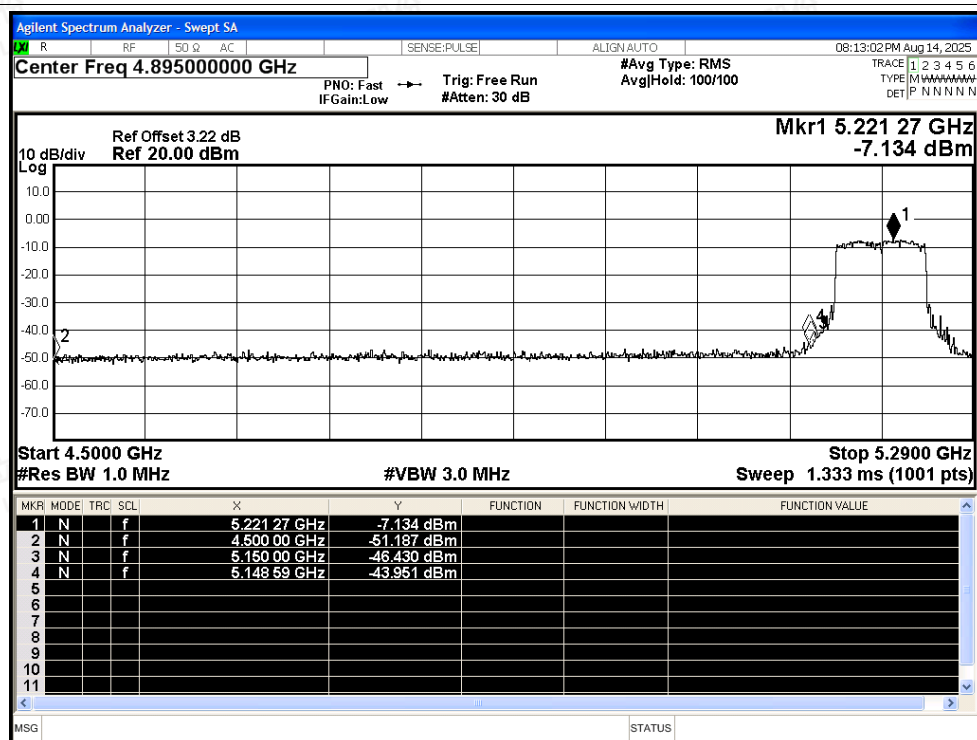

Restrict Band NVNT ac80 5210MHz Ant2 Average

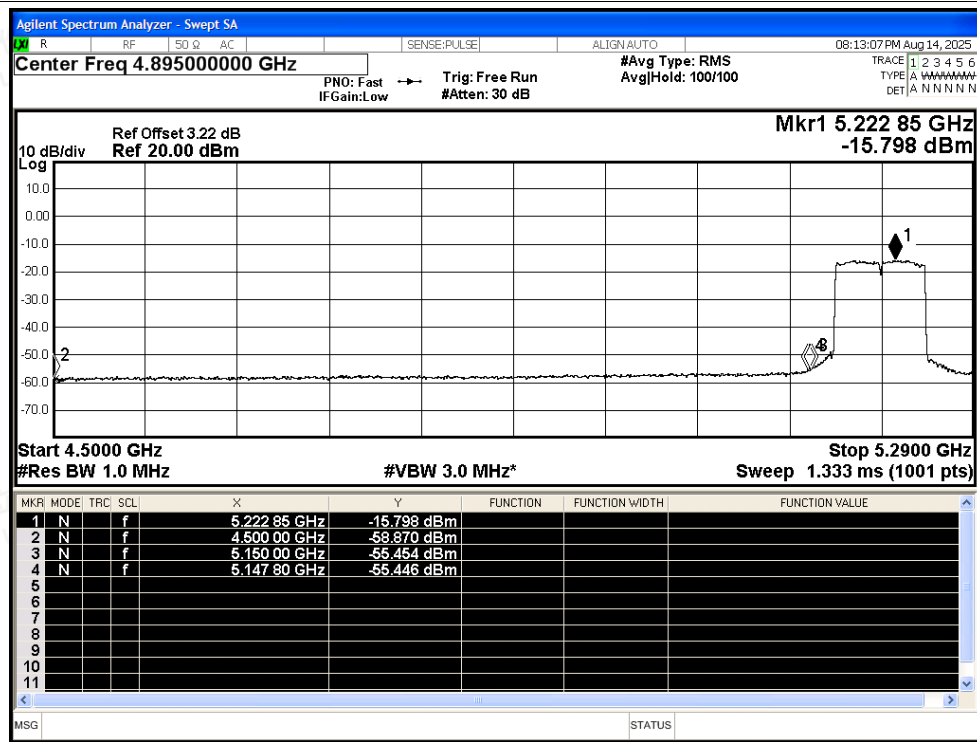

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant1 Power (dBm)	Ant2 Power (dBm)	Sum (Ant1+Ant2)	Gain (dBi)	Total E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5180	-50.46	-51.16	-47.79	5.39	52.83	Peak	68.2	PASS
NVNT	n20	5180	-58.94	-58.95	-55.93	5.39	44.68	Average	54	PASS
NVNT	n20	5180	-45.26	-46.71	-42.91	5.39	57.70	Peak	68.2	PASS
NVNT	n20	5180	-56.06	-56.01	-53.02	5.39	47.59	Average	54	PASS
NVNT	n20	5180	-45.32	-47.09	-43.11	5.39	57.51	Peak	68.2	PASS
NVNT	n20	5180	-56.16	-56.78	-53.45	5.39	47.17	Average	54	PASS
NVNT	n20	5240	-49.27	-49.45	-46.35	5.39	54.27	Peak	68.2	PASS
NVNT	n20	5240	-58.01	-58.21	-55.10	5.39	45.52	Average	54	PASS
NVNT	n20	5240	-47.25	-47.9	-44.55	5.39	56.07	Peak	68.2	PASS
NVNT	n20	5240	-57.47	-57.29	-54.37	5.39	46.25	Average	54	PASS
NVNT	n20	5240	-49.16	-51.14	-47.03	5.39	53.59	Peak	68.2	PASS
NVNT	n20	5240	-57.97	-58.6	-55.26	5.39	45.35	Average	54	PASS
NVNT	n40	5190	-49.37	-51.69	-47.37	5.39	53.25	Peak	68.2	PASS
NVNT	n40	5190	-58.57	-59.58	-56.04	5.39	44.58	Average	54	PASS
NVNT	n40	5190	-40.78	-44.41	-39.22	5.39	61.40	Peak	68.2	PASS
NVNT	n40	5190	-55.49	-55.03	-52.24	5.39	48.37	Average	54	PASS
NVNT	n40	5190	-42.73	-44.41	-40.48	5.39	60.14	Peak	68.2	PASS
NVNT	n40	5190	-55.49	-55.03	-52.24	5.39	48.37	Average	54	PASS
NVNT	n40	5230	-49.4	-50.15	-46.75	5.39	53.87	Peak	68.2	PASS
NVNT	n40	5230	-57.94	-58.21	-55.06	5.39	45.55	Average	54	PASS
NVNT	n40	5230	-47.18	-47.4	-44.28	5.39	56.34	Peak	68.2	PASS
NVNT	n40	5230	-57.43	-57.25	-54.33	5.39	46.29	Average	54	PASS
NVNT	n40	5230	-49.51	-50.88	-47.13	5.39	53.49	Peak	68.2	PASS
NVNT	n40	5230	-58.05	-57.94	-54.98	5.39	45.63	Average	54	PASS
NVNT	ac20	5180	-50.57	-51.03	-47.78	5.39	52.83	Peak	68.2	PASS
NVNT	ac20	5180	-58.88	-58.5	-55.68	5.39	44.94	Average	54	PASS
NVNT	ac20	5180	-46.27	-42.29	-40.83	5.39	59.79	Peak	68.2	PASS
NVNT	ac20	5180	-55.87	-56.02	-52.93	5.39	47.68	Average	54	PASS
NVNT	ac20	5180	-45.53	-46.23	-42.86	5.39	57.76	Peak	68.2	PASS
NVNT	ac20	5180	-56.06	-55.97	-53.00	5.39	47.61	Average	54	PASS
NVNT	ac20	5240	-49.64	-49.4	-46.51	5.39	54.11	Peak	68.2	PASS
NVNT	ac20	5240	-58.06	-58.78	-55.39	5.39	45.22	Average	54	PASS
NVNT	ac20	5240	-47.25	-47.2	-44.21	5.39	56.40	Peak	68.2	PASS
NVNT	ac20	5240	-57.48	-57.19	-54.32	5.39	46.30	Average	54	PASS
NVNT	ac20	5240	-50.47	-49.45	-46.92	5.39	53.70	Peak	68.2	PASS
NVNT	ac20	5240	-58.5	-58.31	-55.39	5.39	45.22	Average	54	PASS
NVNT	ac40	5190	-50.92	-51.01	-47.95	5.39	52.66	Peak	68.2	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	-58.55	-58.45	-55.49	5.39	45.13	Average	54	PASS
NVNT	ac40	5190	-43.87	-36.64	-35.89	5.39	64.73	Peak	68.2	PASS
NVNT	ac40	5190	-55.12	-55.2	-52.15	5.39	48.47	Average	54	PASS
NVNT	ac40	5190	-44.86	-36.64	-36.03	5.39	64.59	Peak	68.2	PASS
NVNT	ac40	5190	-55.12	-55.45	-52.27	5.39	48.35	Average	54	PASS
NVNT	ac40	5230	-50.52	-50.3	-47.40	5.39	53.22	Peak	68.2	PASS
NVNT	ac40	5230	-58.18	-58.17	-55.16	5.39	45.45	Average	54	PASS
NVNT	ac40	5230	-47.51	-47.33	-44.41	5.39	56.21	Peak	68.2	PASS
NVNT	ac40	5230	-57.5	-57.51	-54.49	5.39	46.12	Average	54	PASS
NVNT	ac40	5230	-51.01	-49.15	-46.97	5.39	53.65	Peak	68.2	PASS
NVNT	ac40	5230	-58.38	-58.28	-55.32	5.39	45.30	Average	54	PASS
NVNT	ac80	5210	-48.28	-47.44	-44.83	5.39	55.79	Peak	68.2	PASS
NVNT	ac80	5210	-56.91	-56.62	-53.75	5.39	46.87	Average	54	PASS
NVNT	ac80	5210	-46.76	-45.47	-43.06	5.39	57.56	Peak	68.2	PASS
NVNT	ac80	5210	-56.1	-56.38	-53.23	5.39	47.39	Average	54	PASS
NVNT	ac80	5210	-50.25	-50.34	-47.28	5.39	53.33	Peak	68.2	PASS
NVNT	ac80	5210	-57.95	-57.85	-54.89	5.39	45.73	Average	54	PASS
NVNT	ac80	5210	-49.58	-51.19	-47.30	5.39	53.32	Peak	68.2	PASS
NVNT	ac80	5210	-58.19	-58.87	-55.51	5.39	45.11	Average	54	PASS
NVNT	ac80	5210	-43.79	-43.95	-40.86	5.39	59.76	Peak	68.2	PASS
NVNT	ac80	5210	-55.08	-55.45	-52.25	5.39	48.37	Average	54	PASS
NVNT	ac80	5210	-45.57	-46.43	-42.97	5.39	57.65	Peak	68.2	PASS
NVNT	ac80	5210	-55.13	-55.45	-52.28	5.39	48.34	Average	54	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.5 Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	n20	5180	Ant1	5180	0	0	25	Pass
NVNT	n20	5200	Ant1	5200	0	0	25	Pass
NVNT	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant1	5190	0	0	25	Pass
NVNT	n40	5230	Ant1	5230	0	0	25	Pass
NVNT	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant1	5200	0	0	25	Pass
NVNT	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
NVNT	ac40	5230	Ant1	5230.04	40000	7.65	25	Pass
NVNT	ac80	5210	Ant1	5210	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5180MHz Ant1

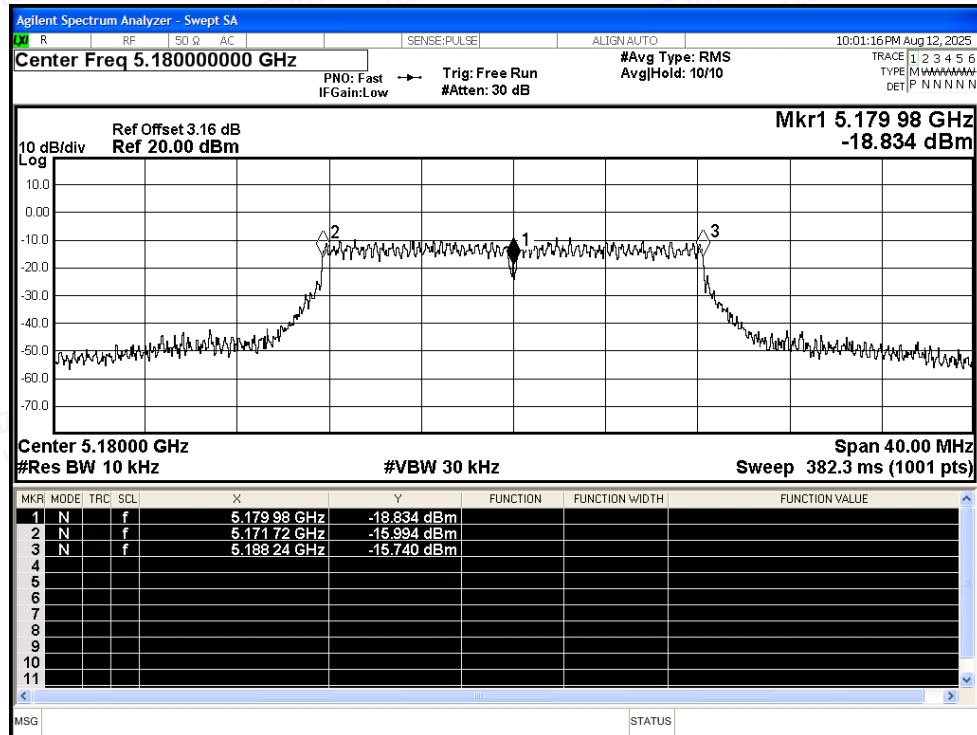

Freq. Stability NVNT a 5200MHz Ant1

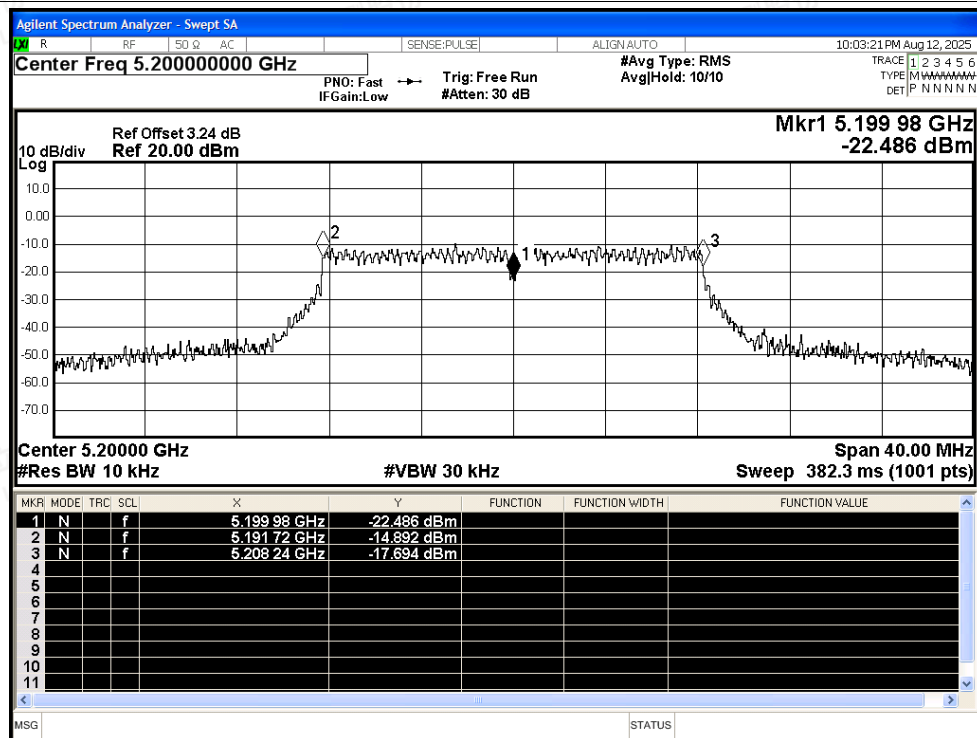

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant1

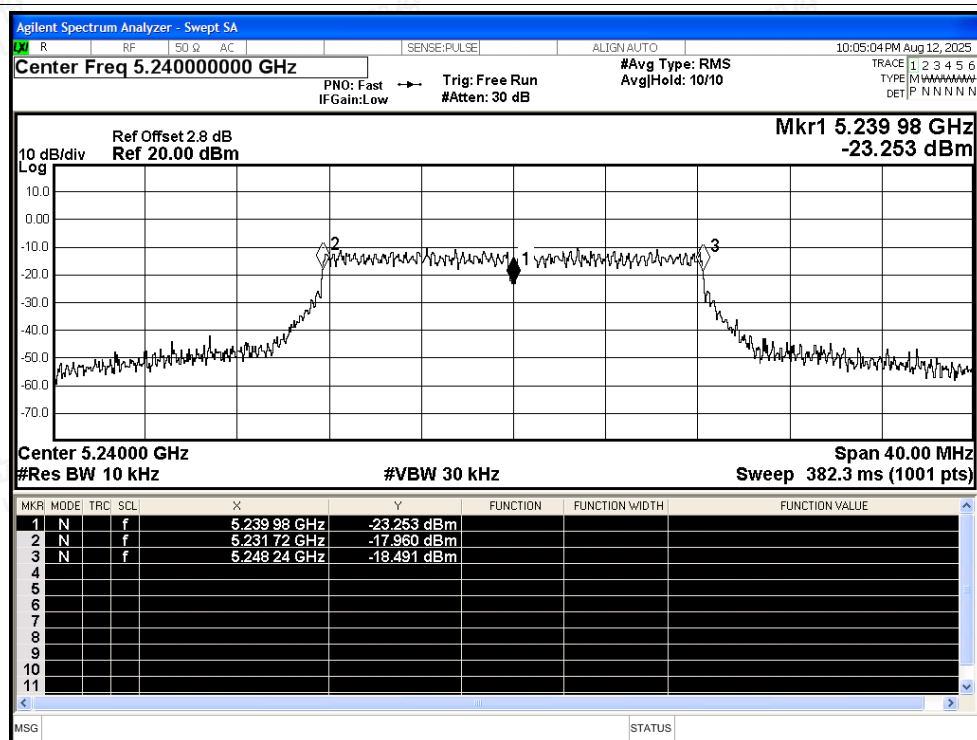

Freq. Stability NVNT n20 5180MHz Ant1

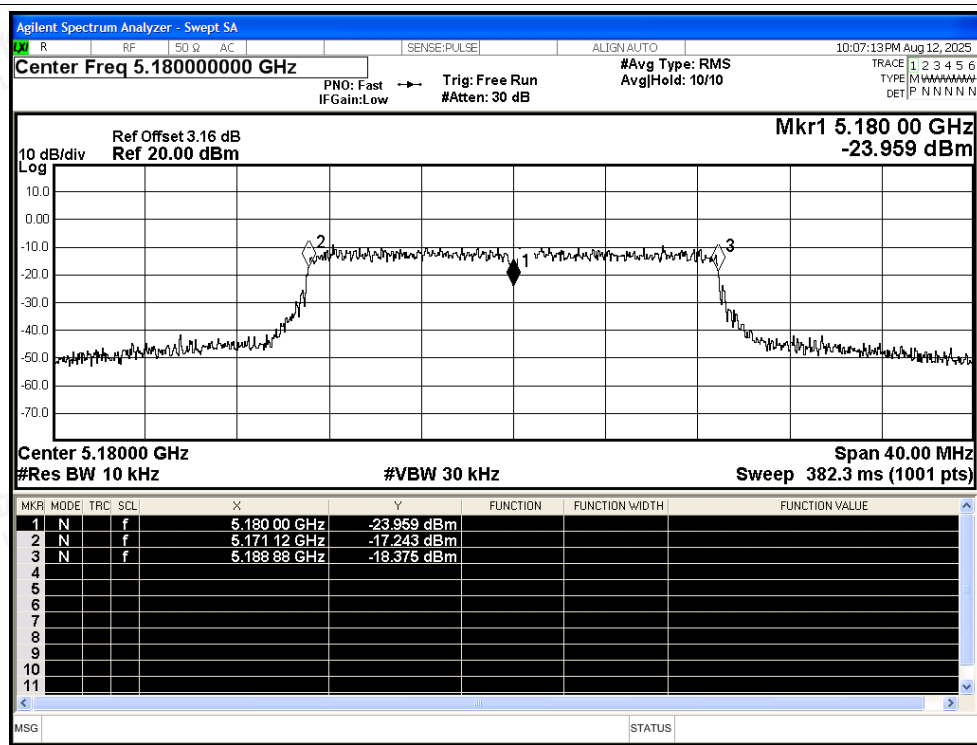

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant1

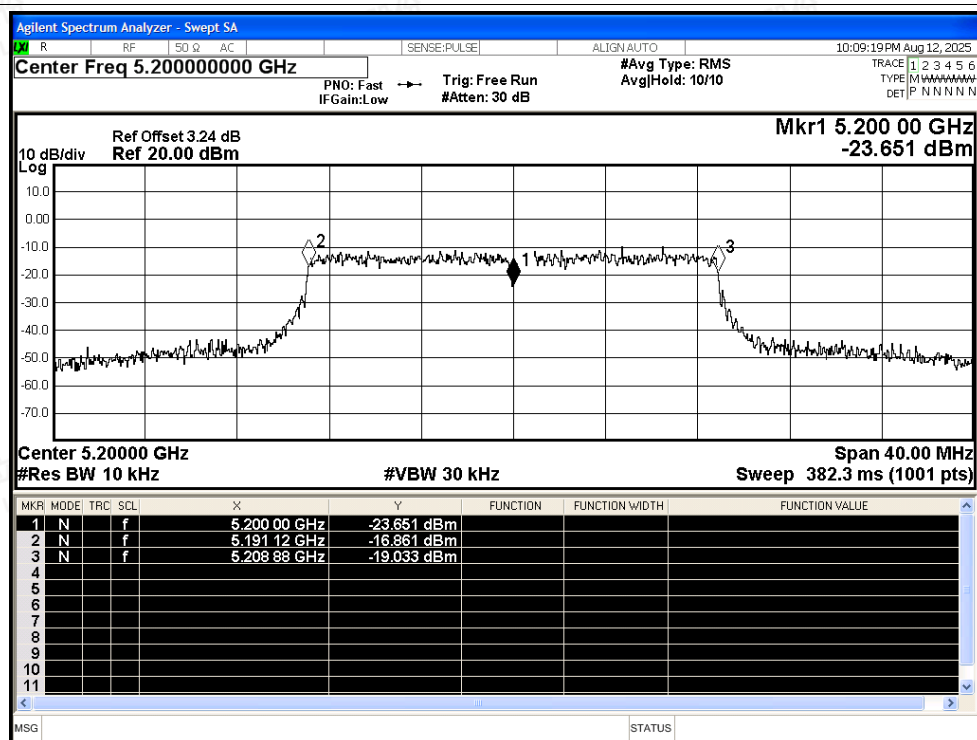

Freq. Stability NVNT n20 5240MHz Ant1

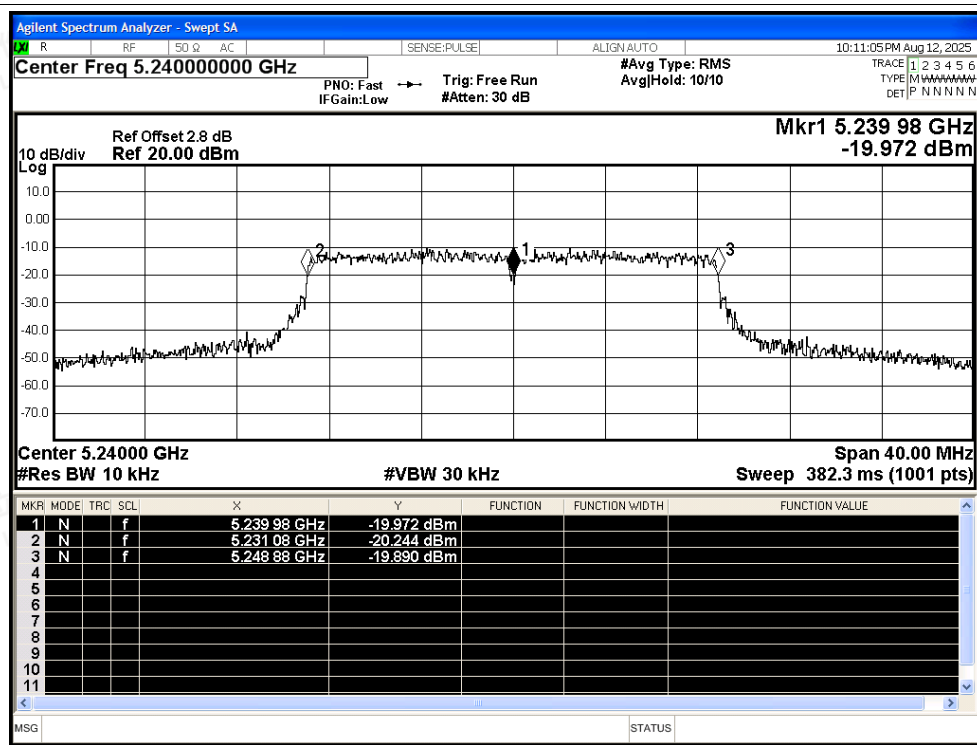

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant1

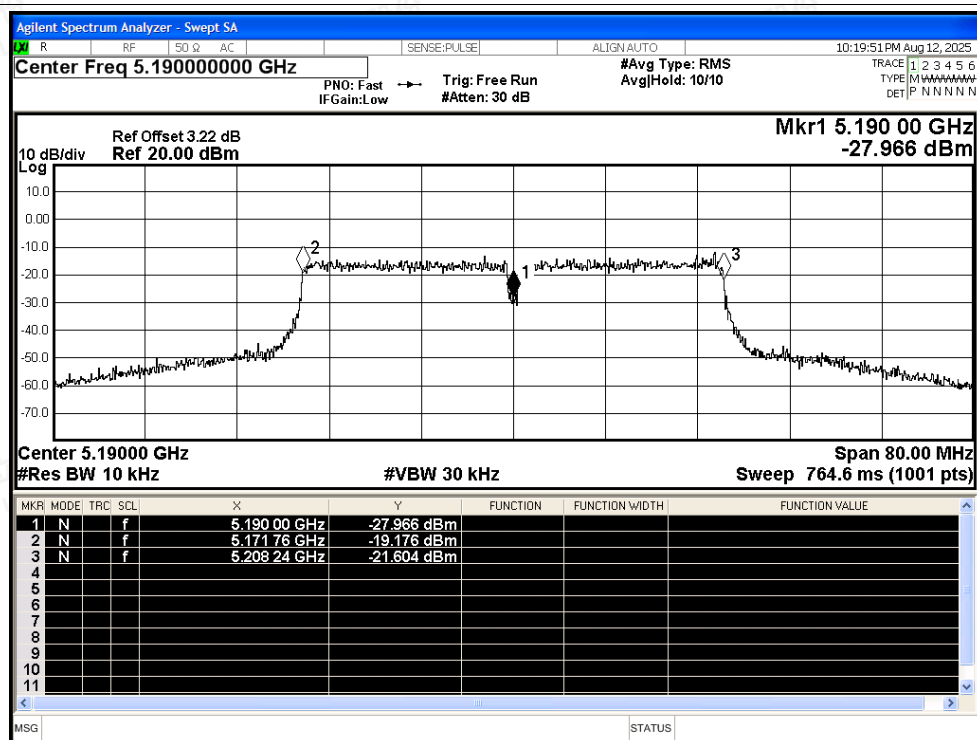

Freq. Stability NVNT n40 5230MHz Ant1

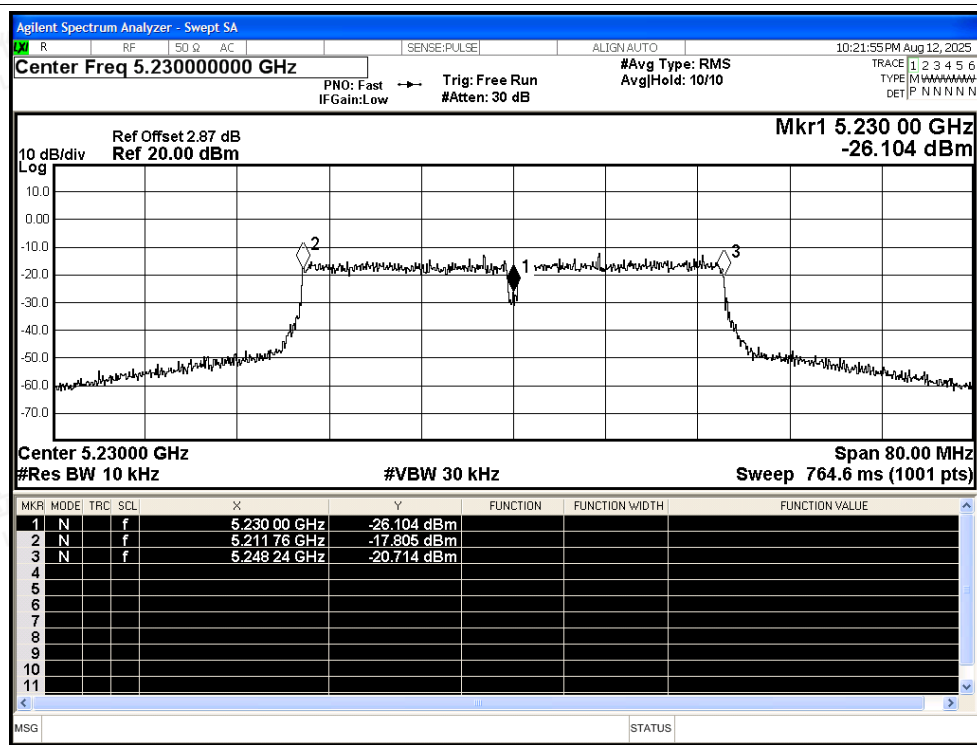

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5180MHz Ant1

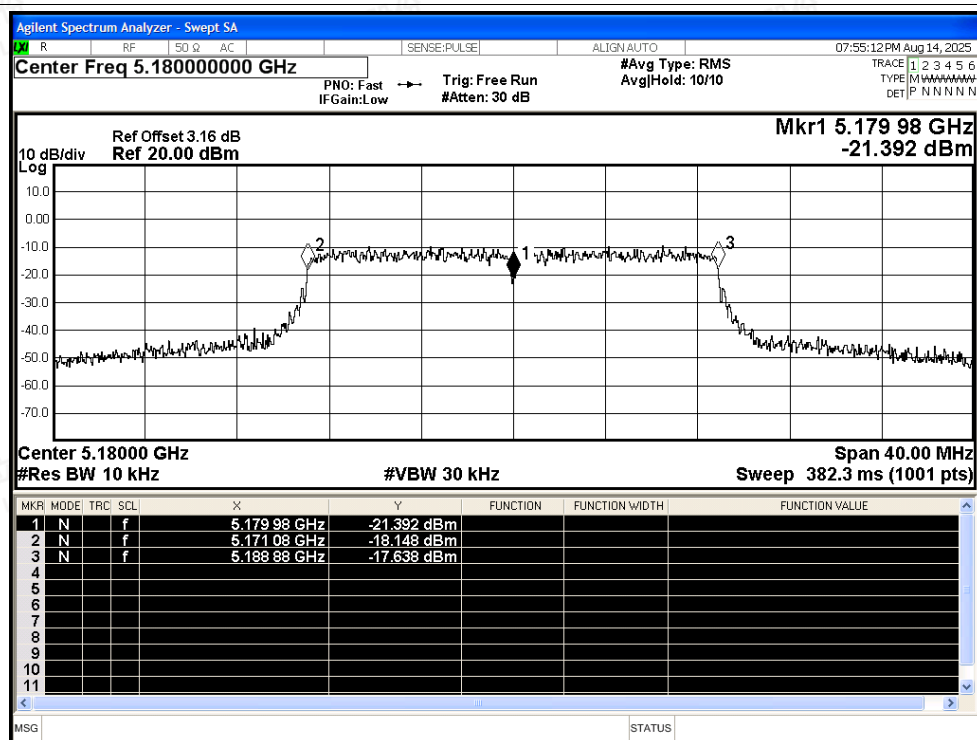

Freq. Stability NVNT ac20 5200MHz Ant1

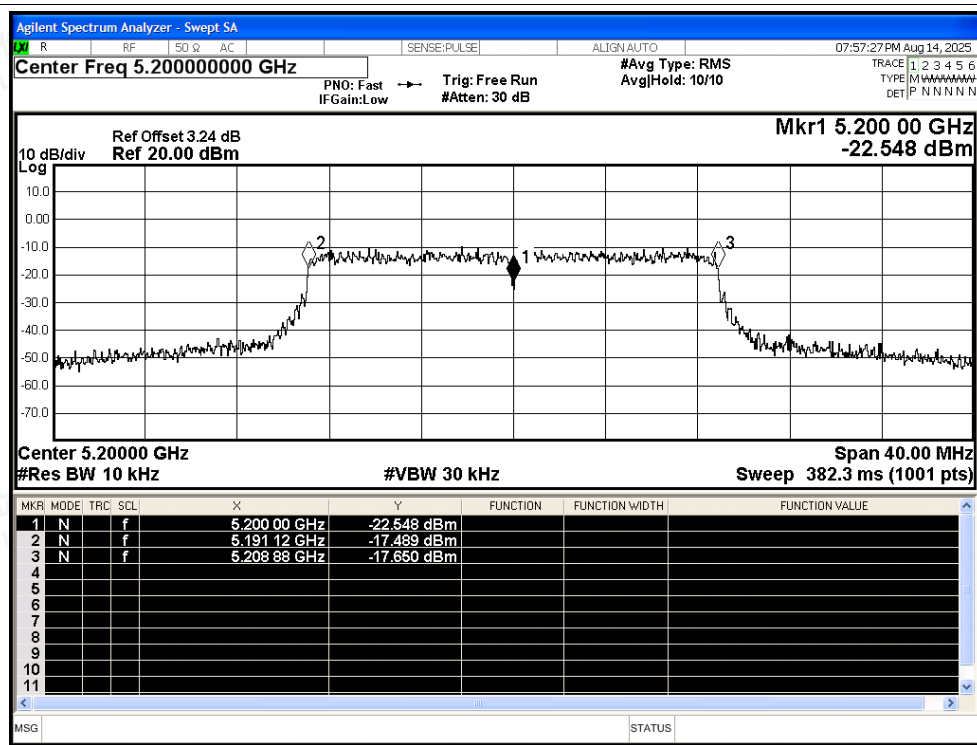

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5240MHz Ant1

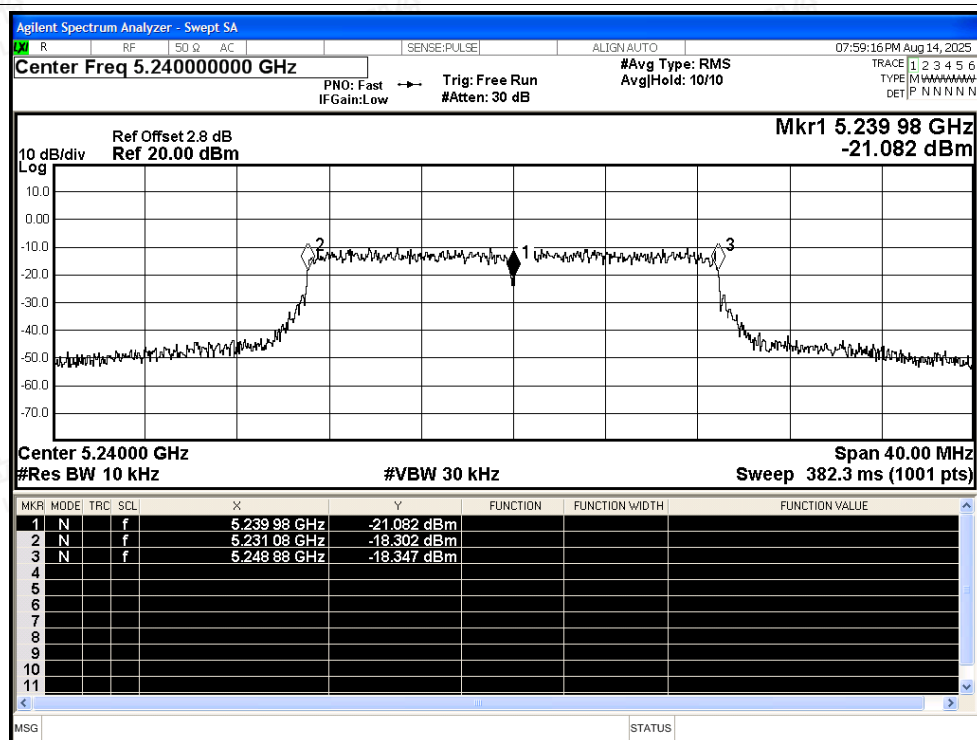

Freq. Stability NVNT ac40 5190MHz Ant1

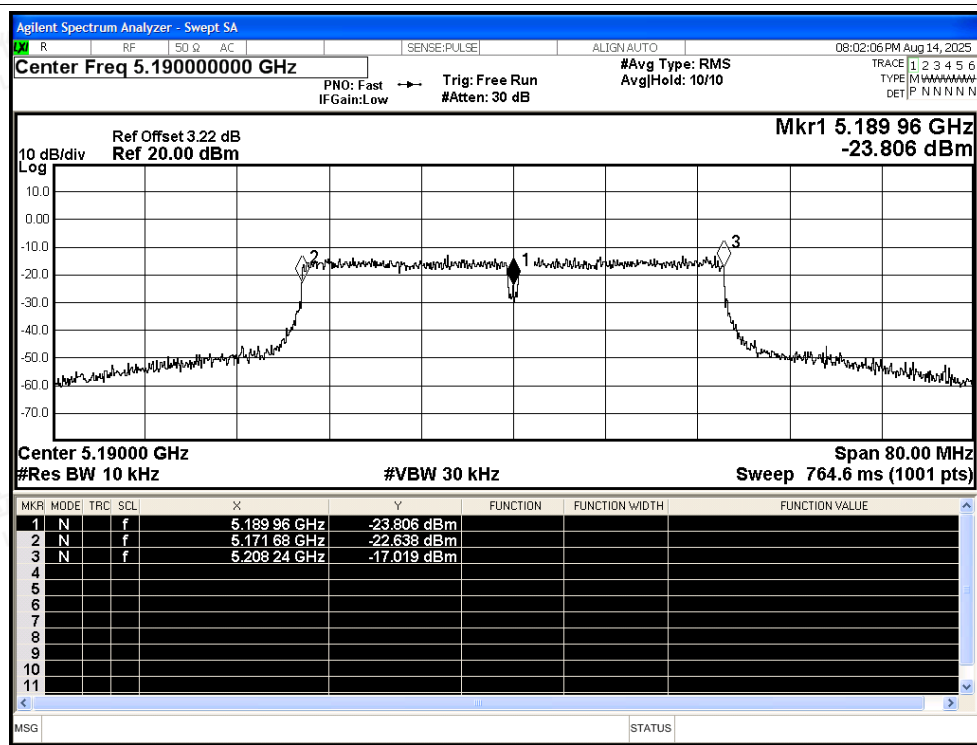

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant1

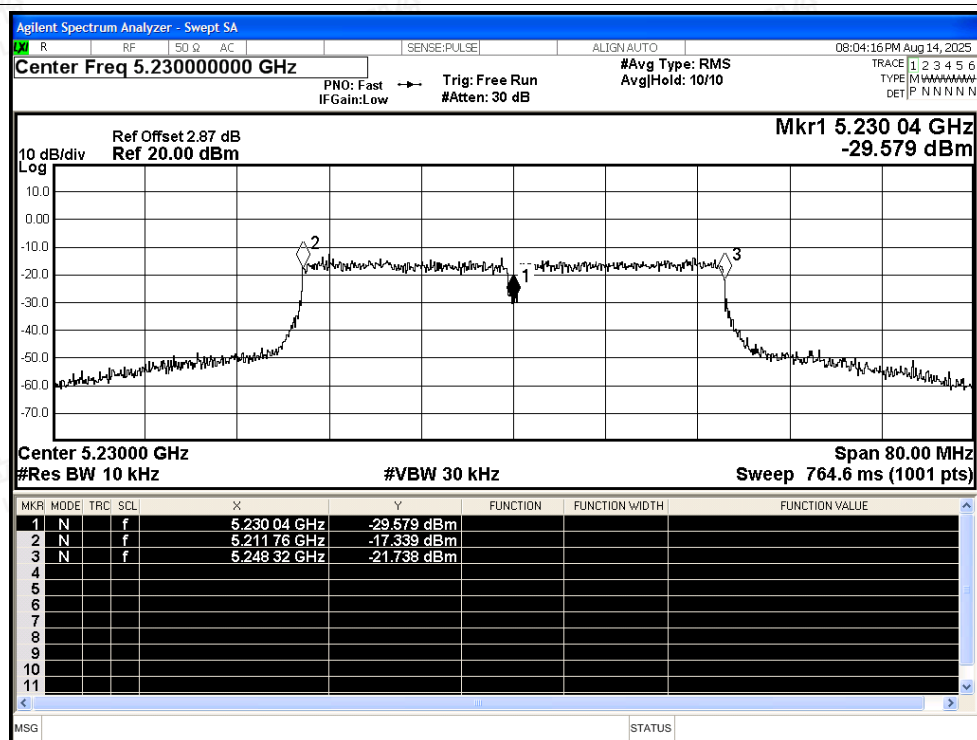

Freq. Stability NVNT ac80 5210MHz Ant1

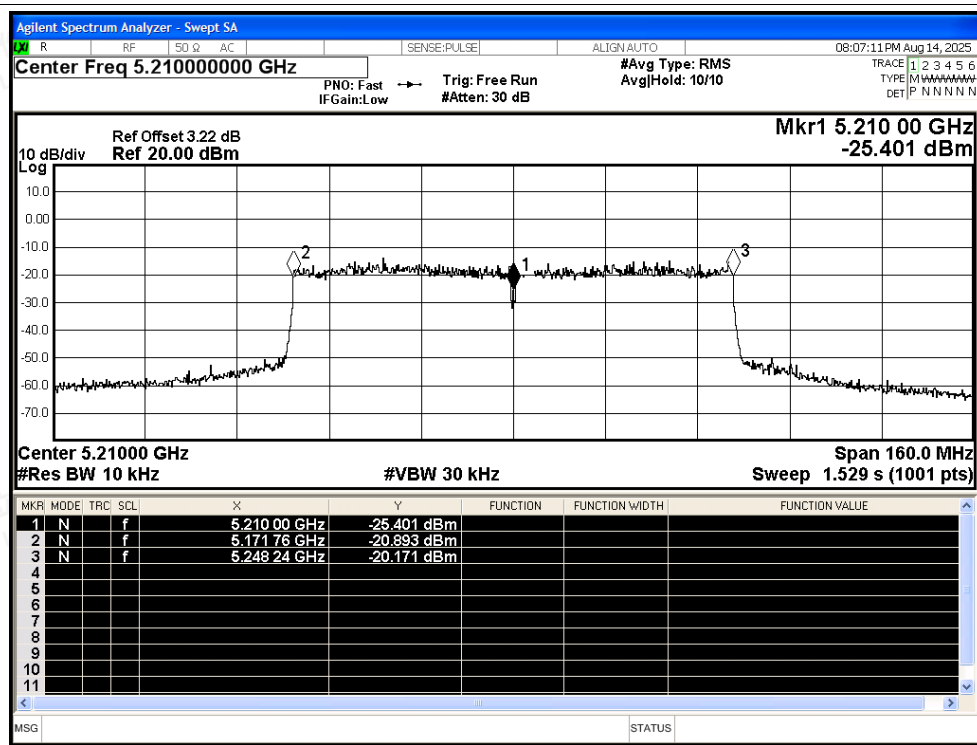

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant2	5180	0	0	25	Pass
NVNT	a	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	n20	5180	Ant2	5179.96	-40000	-7.72	25	Pass
NVNT	n20	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant2	5239.96	-40000	-7.63	25	Pass
NVNT	n40	5190	Ant2	5190	0	0	25	Pass
NVNT	n40	5230	Ant2	5230	0	0	25	Pass
NVNT	ac20	5180	Ant2	5179.96	-40000	-7.72	25	Pass
NVNT	ac20	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant2	5190	0	0	25	Pass
NVNT	ac40	5230	Ant2	5230	0	0	25	Pass
NVNT	ac80	5210	Ant2	5210	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5180MHz Ant2

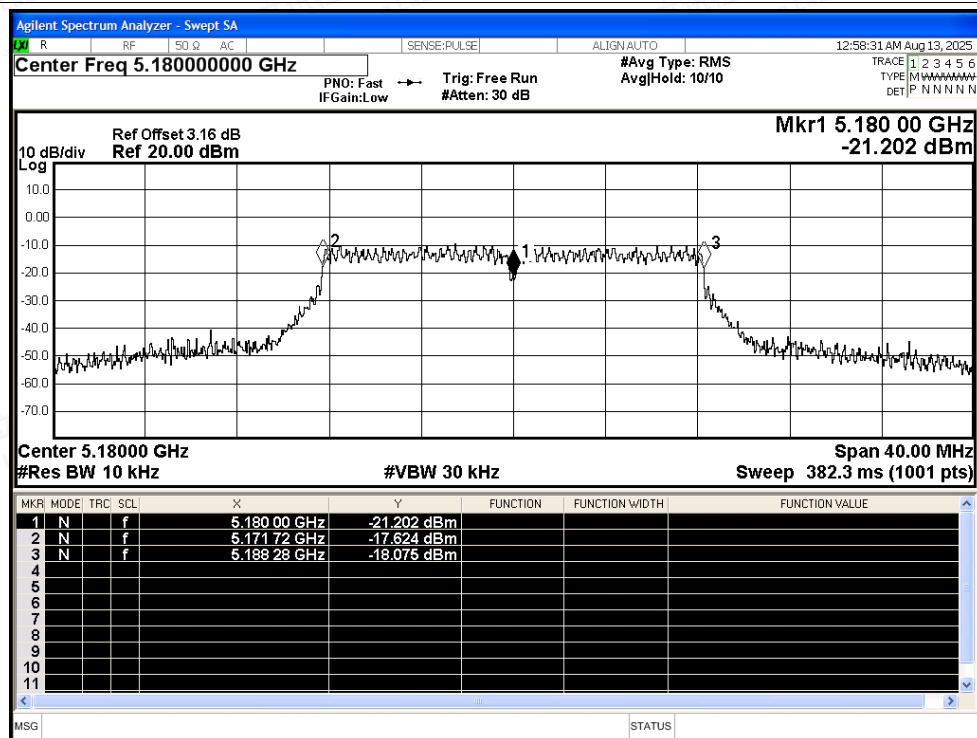

Freq. Stability NVNT a 5200MHz Ant2

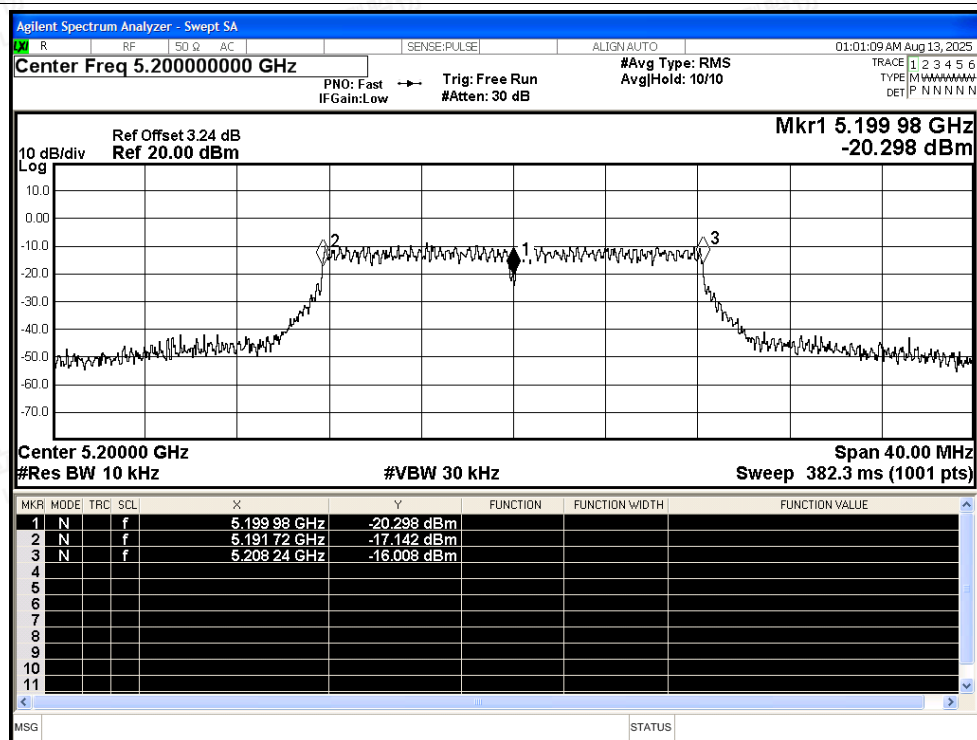

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant2

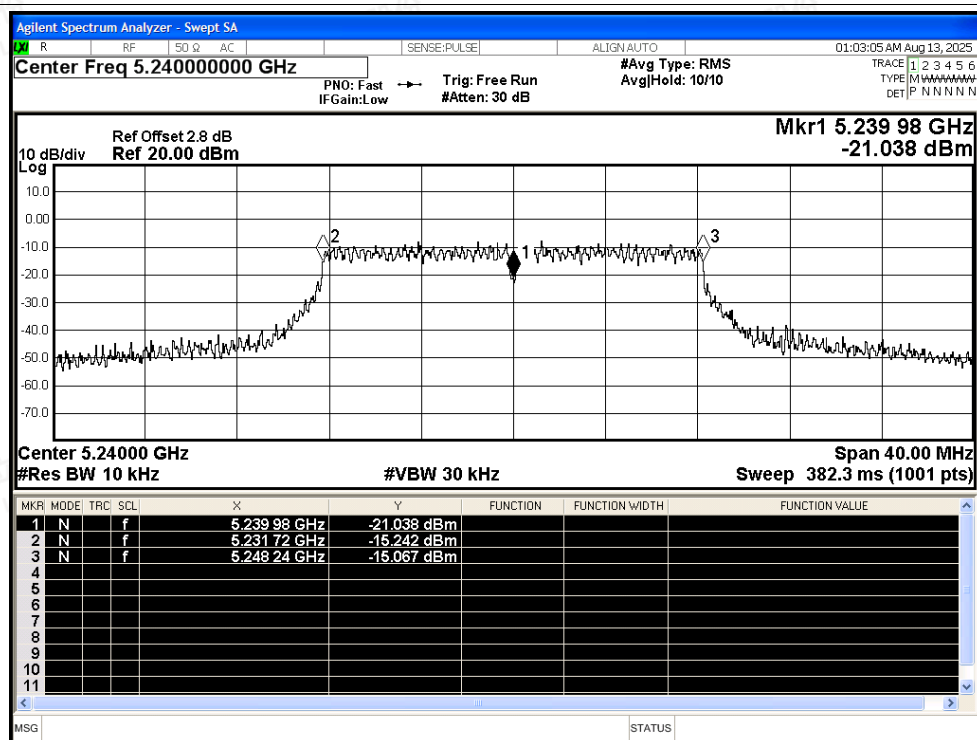

Freq. Stability NVNT n20 5180MHz Ant2

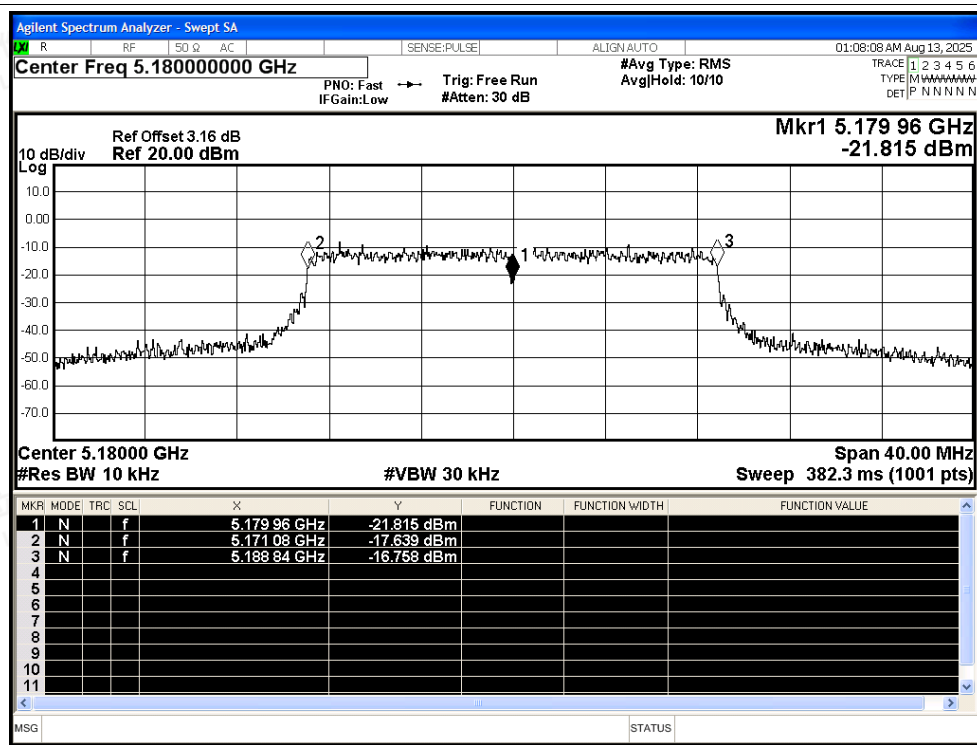

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant2

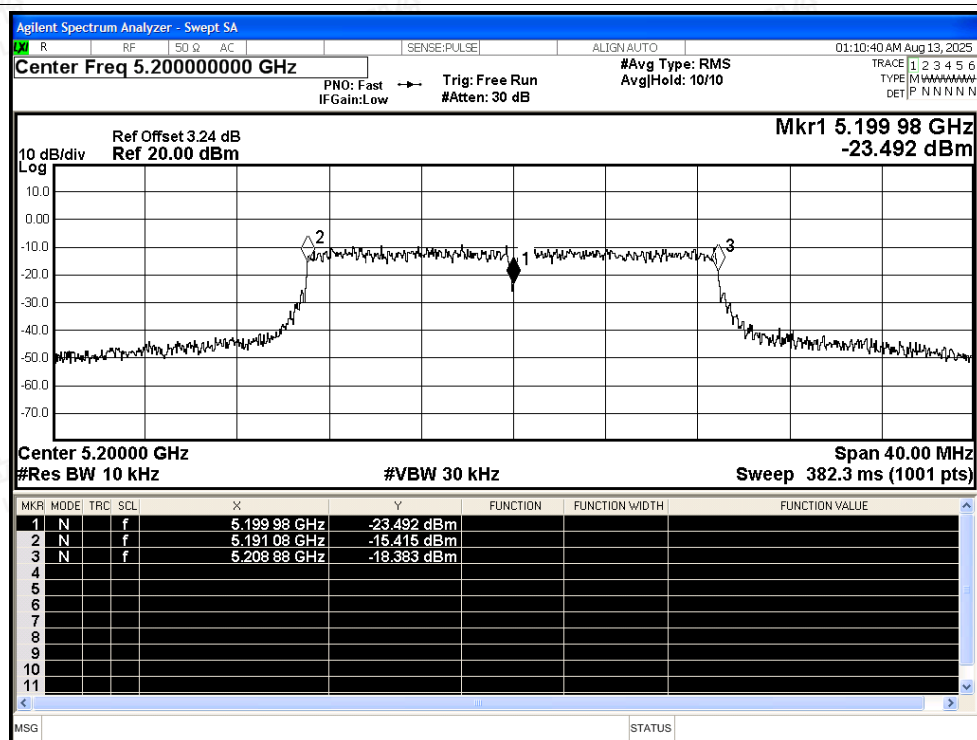

Freq. Stability NVNT n20 5240MHz Ant2

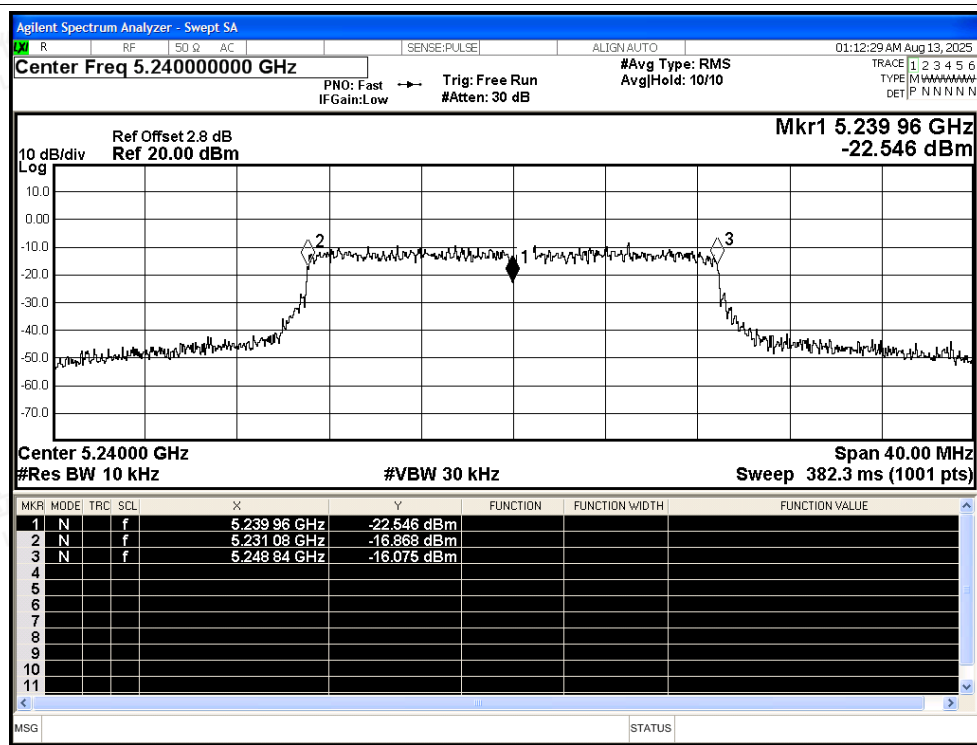

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant2

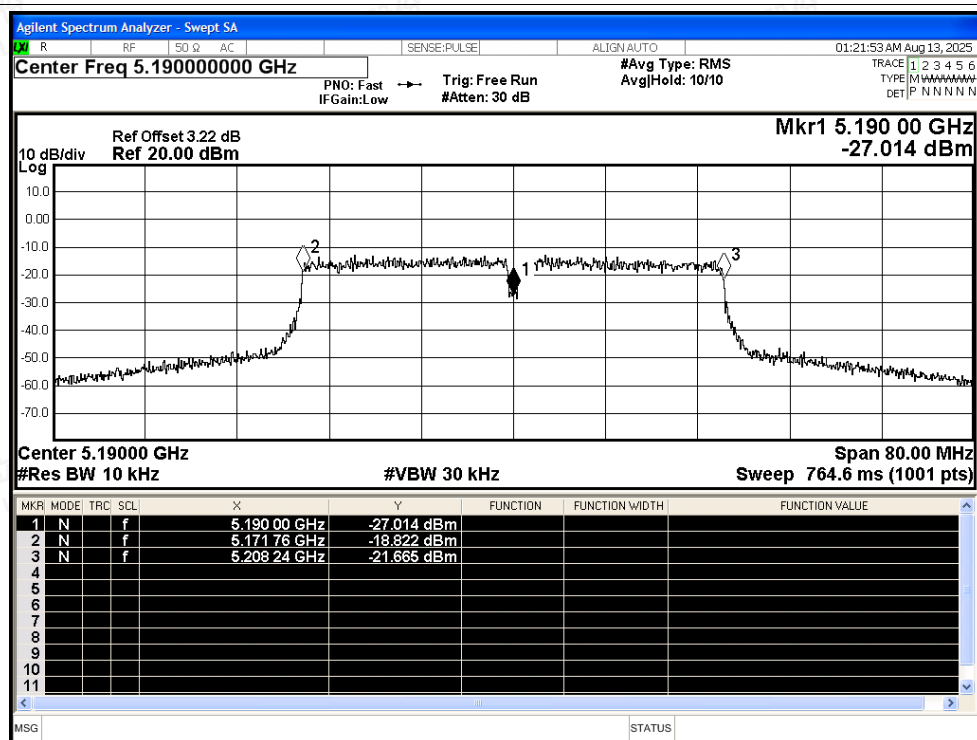

Freq. Stability NVNT n40 5230MHz Ant2

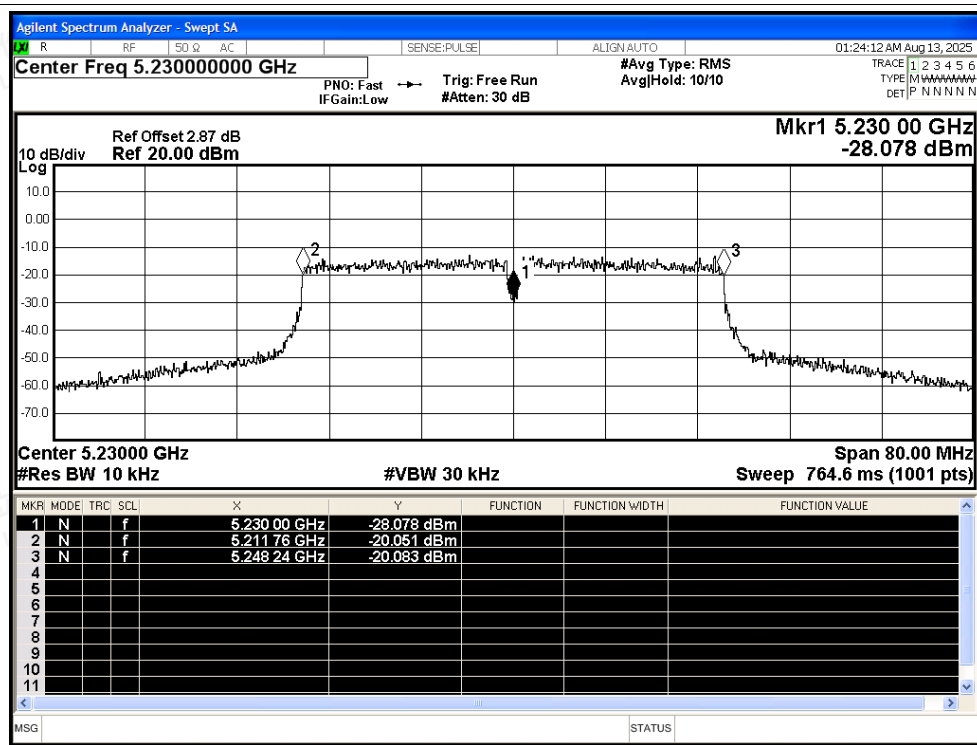

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5180MHz Ant2

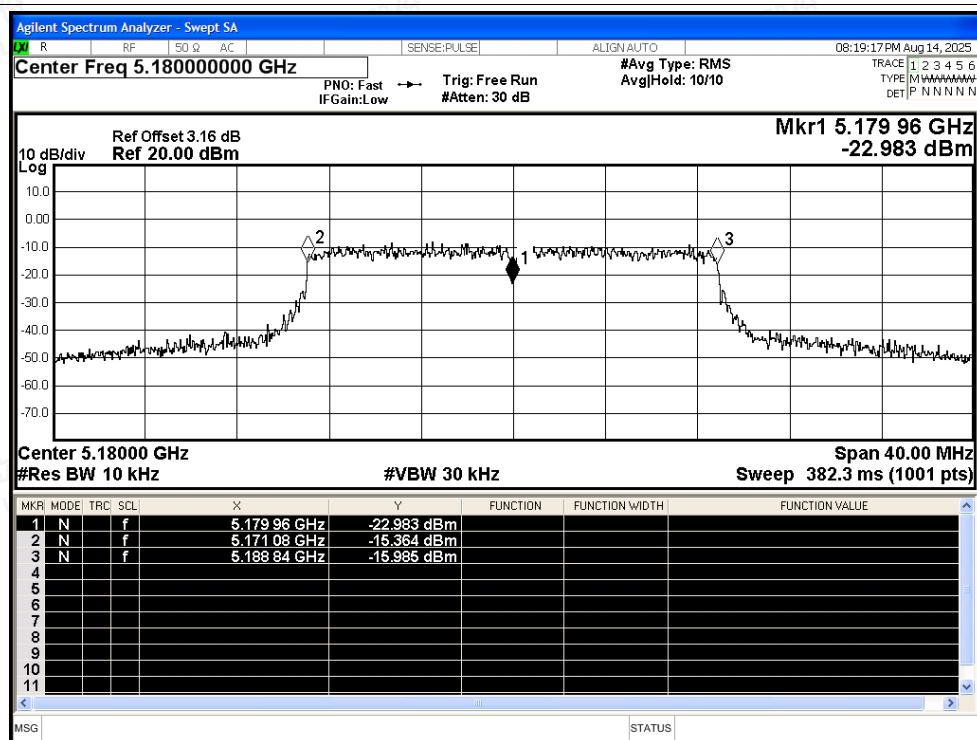

Freq. Stability NVNT ac20 5200MHz Ant2

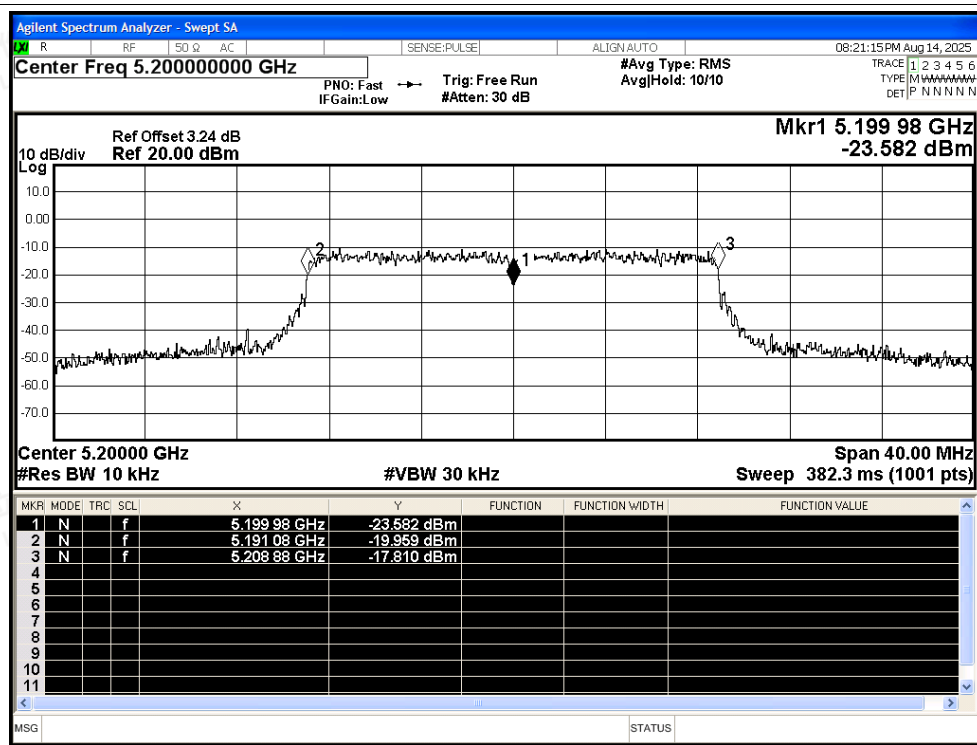

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5240MHz Ant2

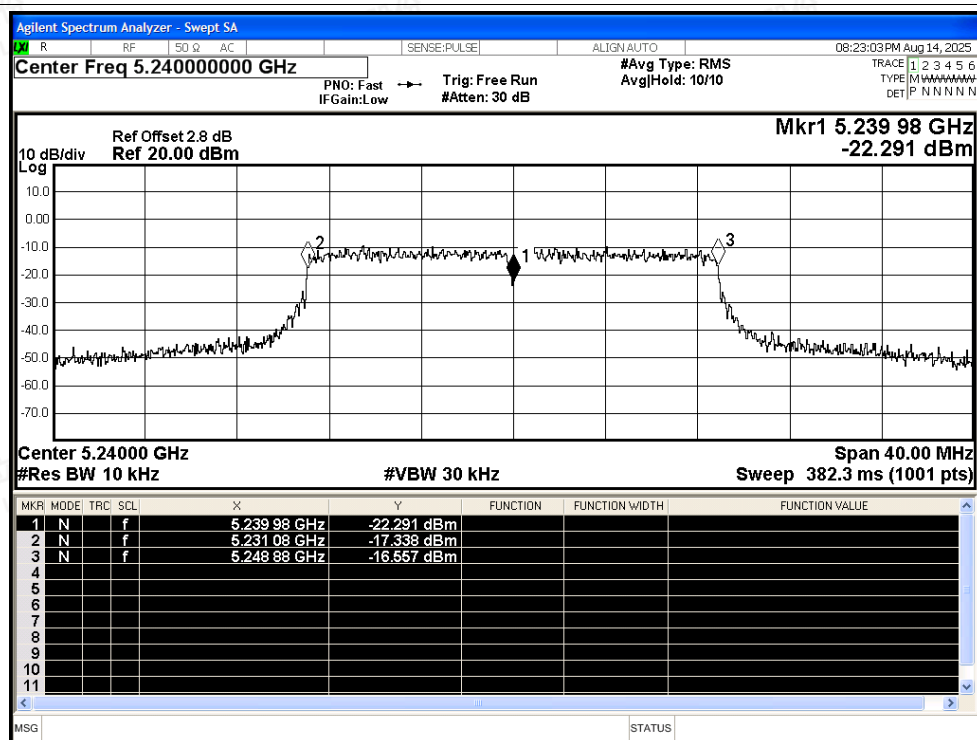

Freq. Stability NVNT ac40 5190MHz Ant2

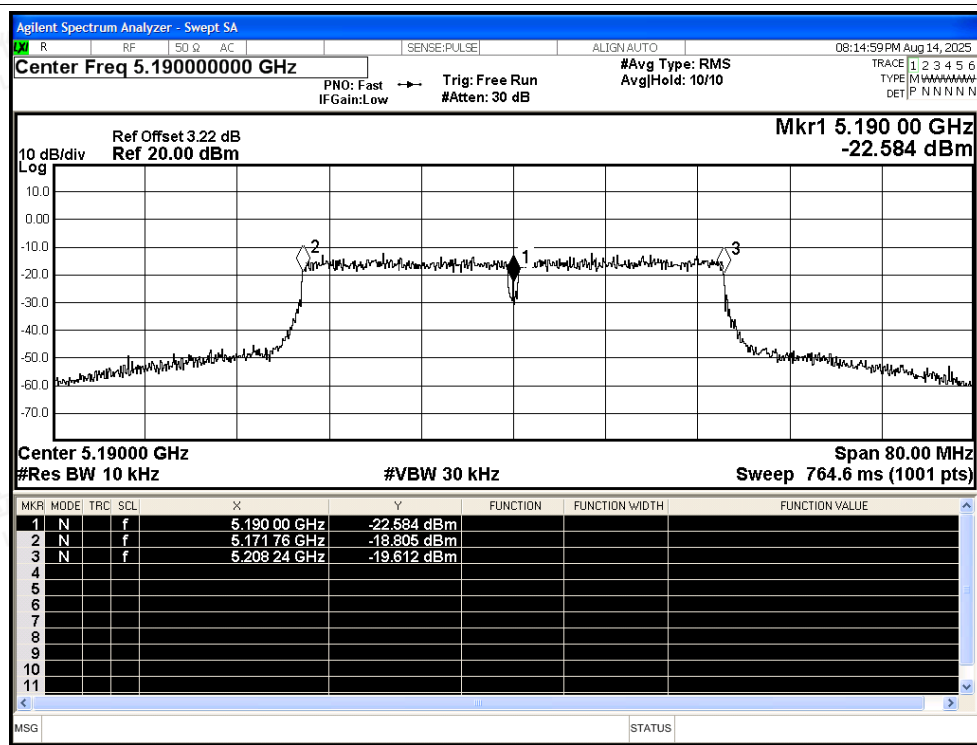

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant2

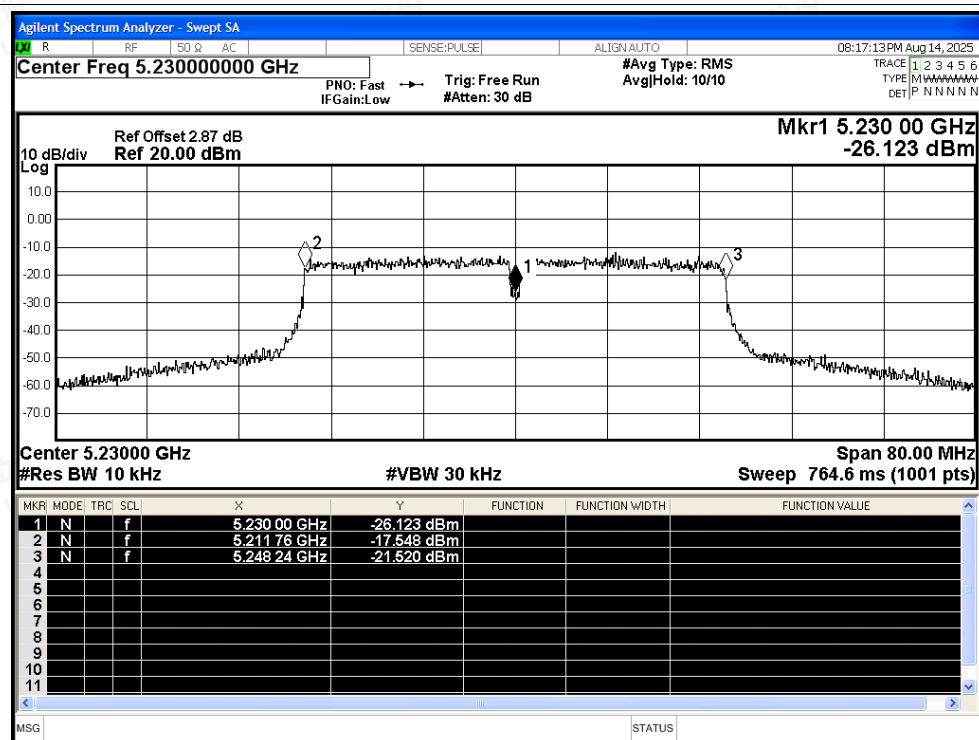

Freq. Stability NVNT ac80 5210MHz Ant2

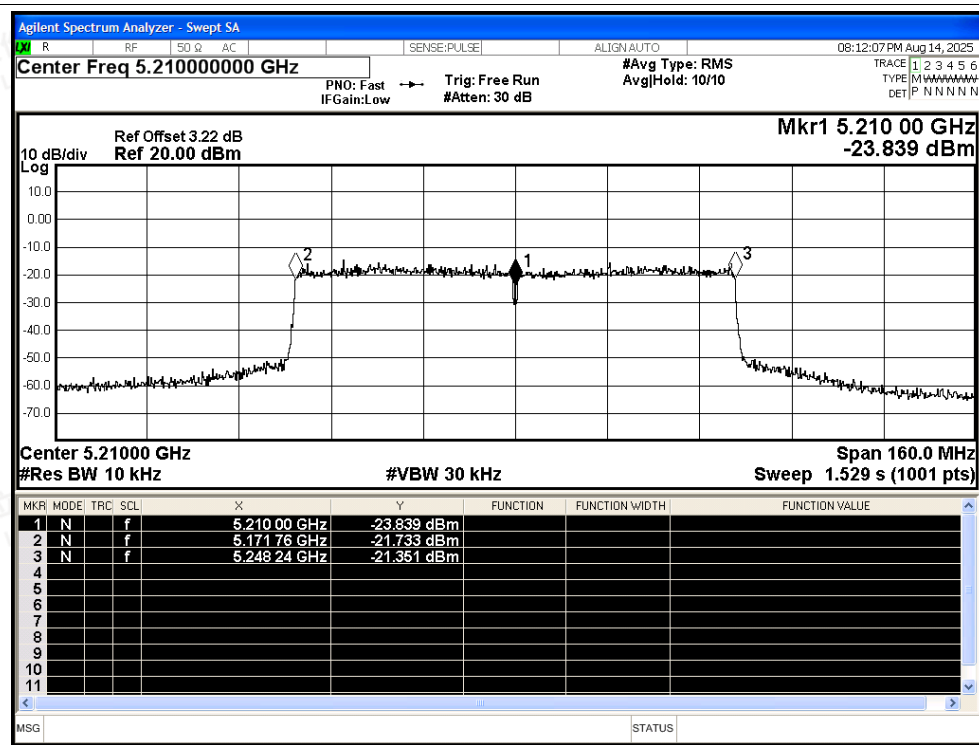

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.6 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant1	94.56	0.24	0.91
NVNT	a	5200	Ant1	94.56	0.24	0.91
NVNT	a	5240	Ant1	94.65	0.24	0.91
NVNT	n20	5180	Ant1	97.29	0.12	0.44
NVNT	n20	5200	Ant1	97.29	0.12	0.44
NVNT	n20	5240	Ant1	97.29	0.12	0.44
NVNT	n40	5190	Ant1	94.79	0.23	0.9
NVNT	n40	5230	Ant1	94.79	0.23	0.9
NVNT	ac20	5180	Ant1	97.34	0.12	0.44
NVNT	ac20	5200	Ant1	97.34	0.12	0.44
NVNT	ac20	5240	Ant1	97.3	0.12	0.44
NVNT	ac40	5190	Ant1	94.72	0.24	0.9
NVNT	ac40	5230	Ant1	94.81	0.23	0.9
NVNT	ac80	5210	Ant1	89.65	0.47	1.86






Test Graphs

Duty Cycle NVNT a 5180MHz Ant1

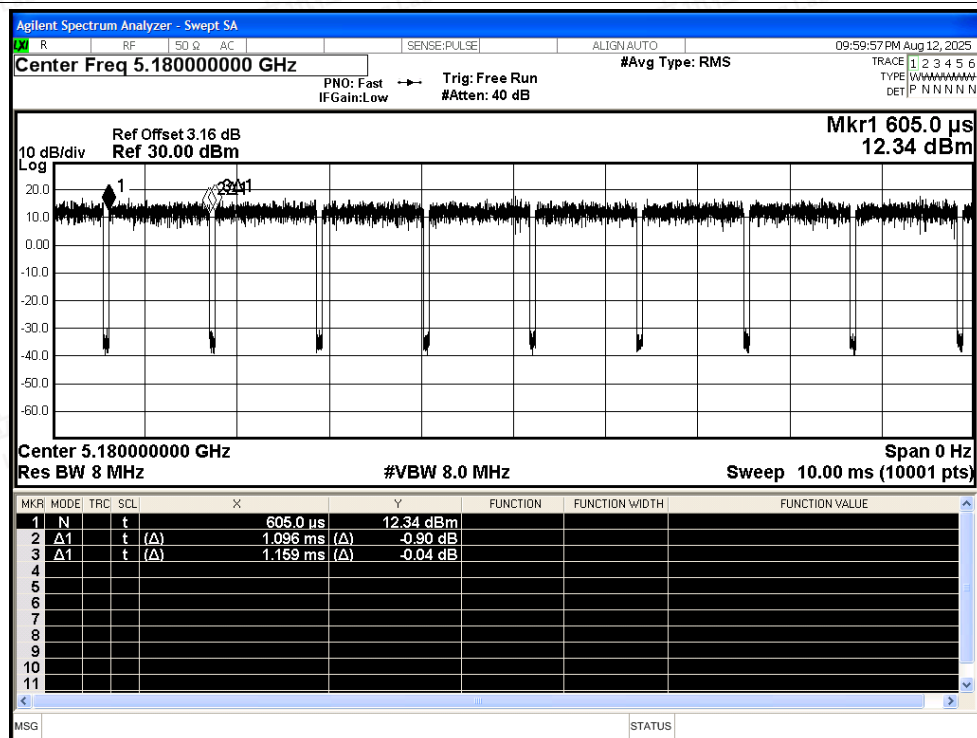

Duty Cycle NVNT a 5200MHz Ant1

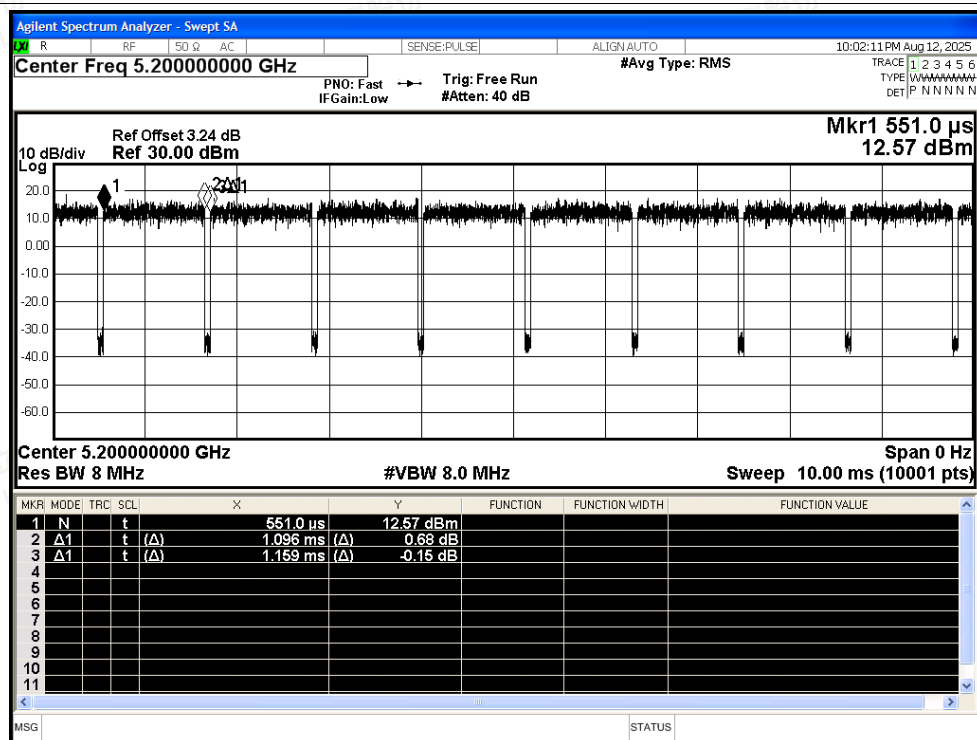

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5240MHz Ant1

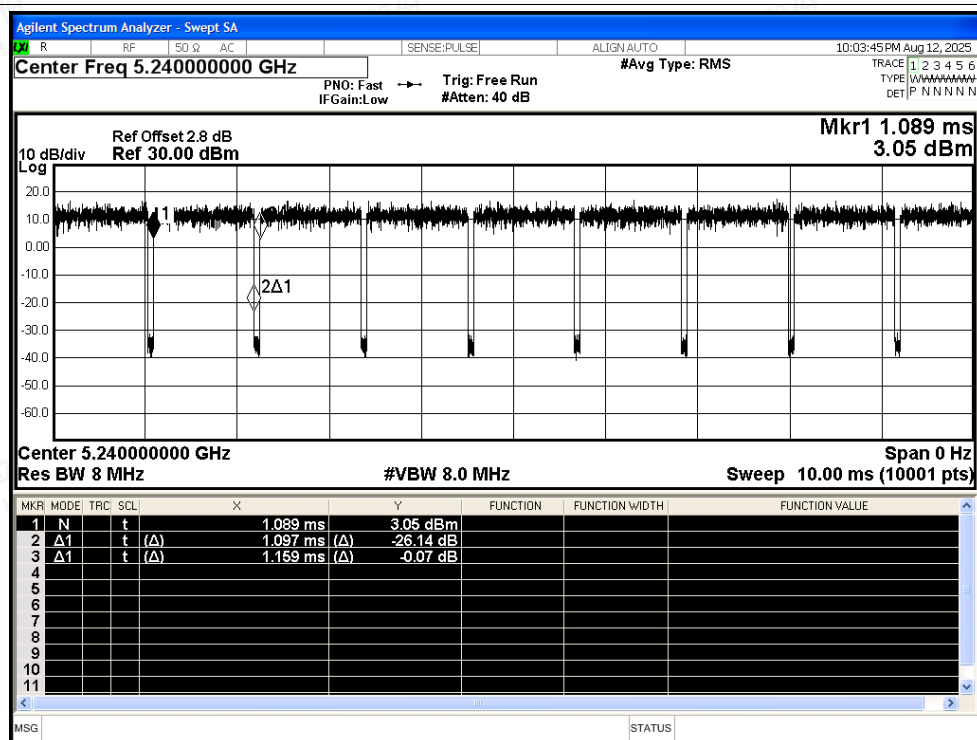

Duty Cycle NVNT n20 5180MHz Ant1

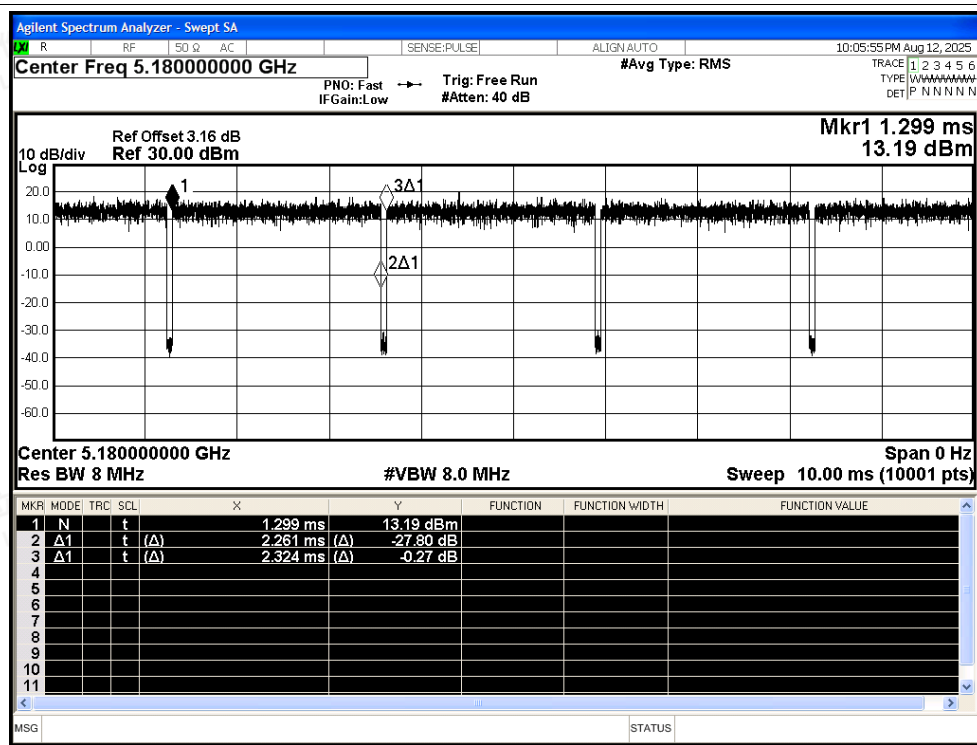

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5200MHz Ant1

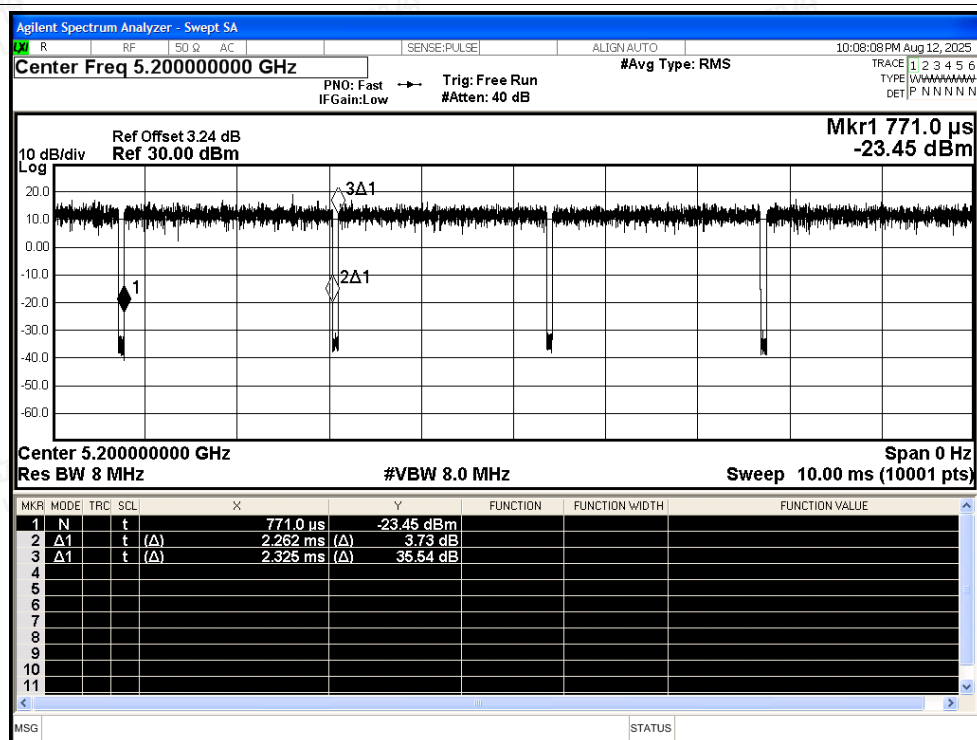

Duty Cycle NVNT n20 5240MHz Ant1

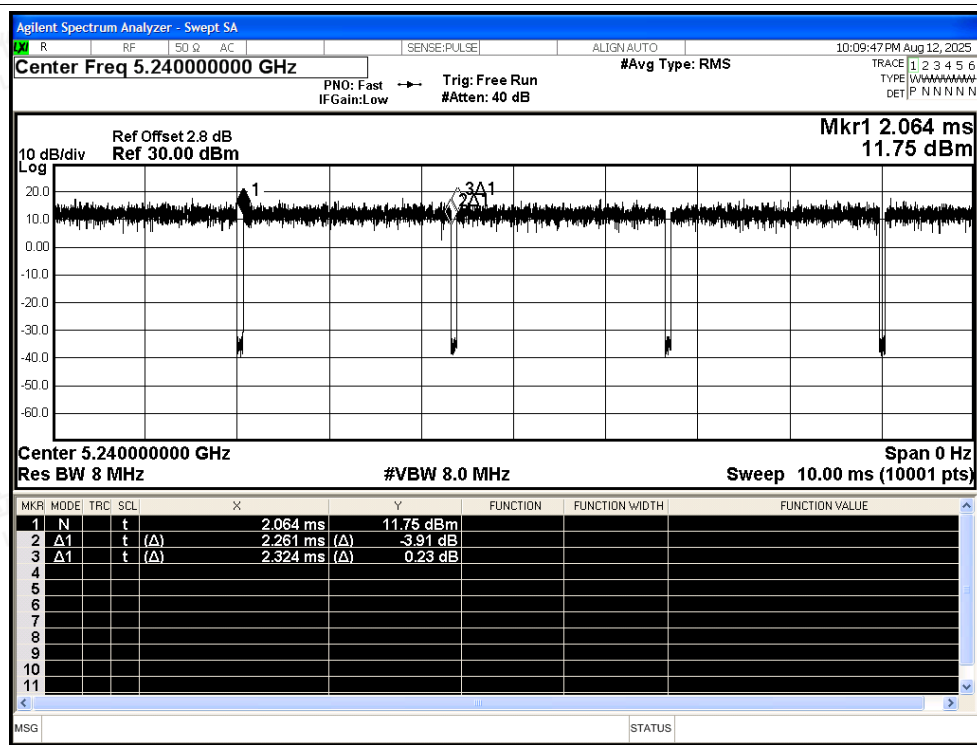

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5190MHz Ant1

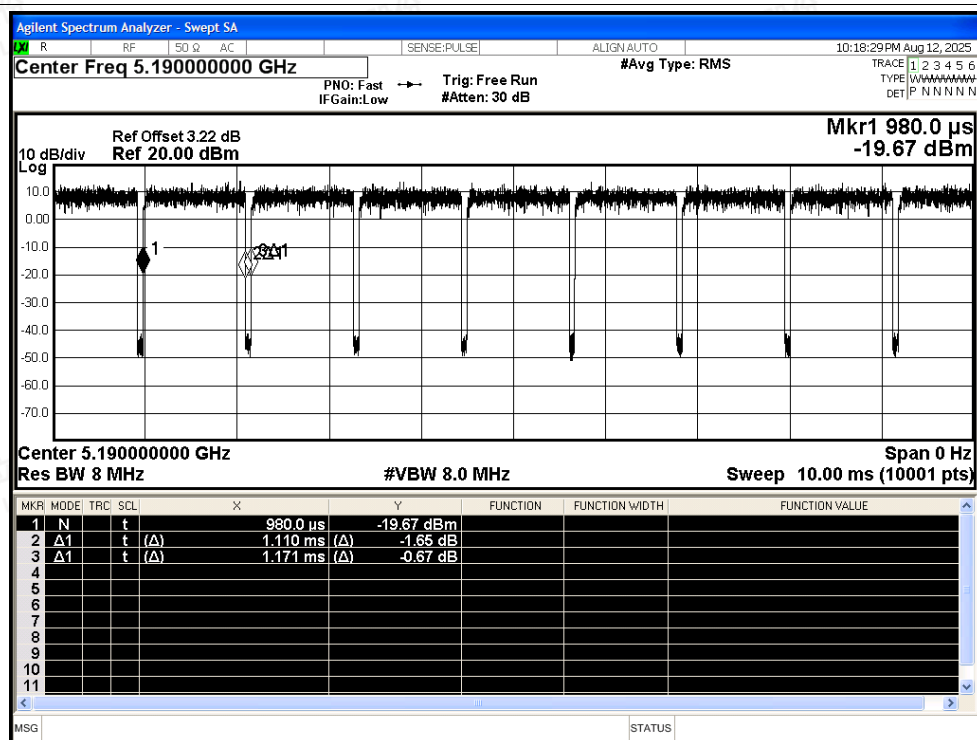

Duty Cycle NVNT n40 5230MHz Ant1

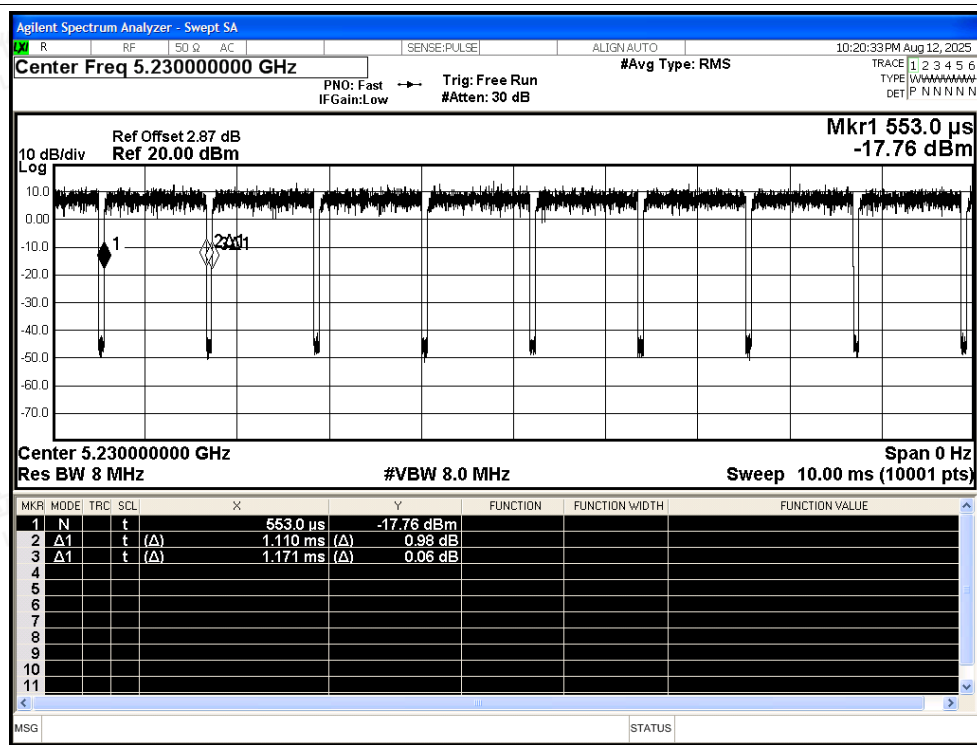

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5180MHz Ant1

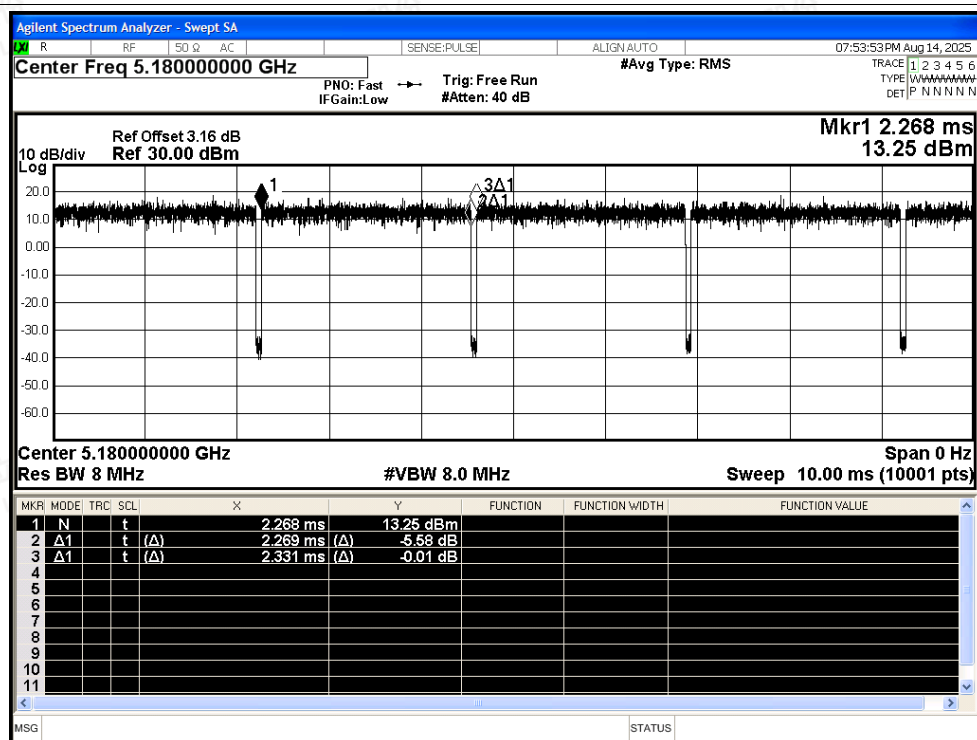

Duty Cycle NVNT ac20 5200MHz Ant1

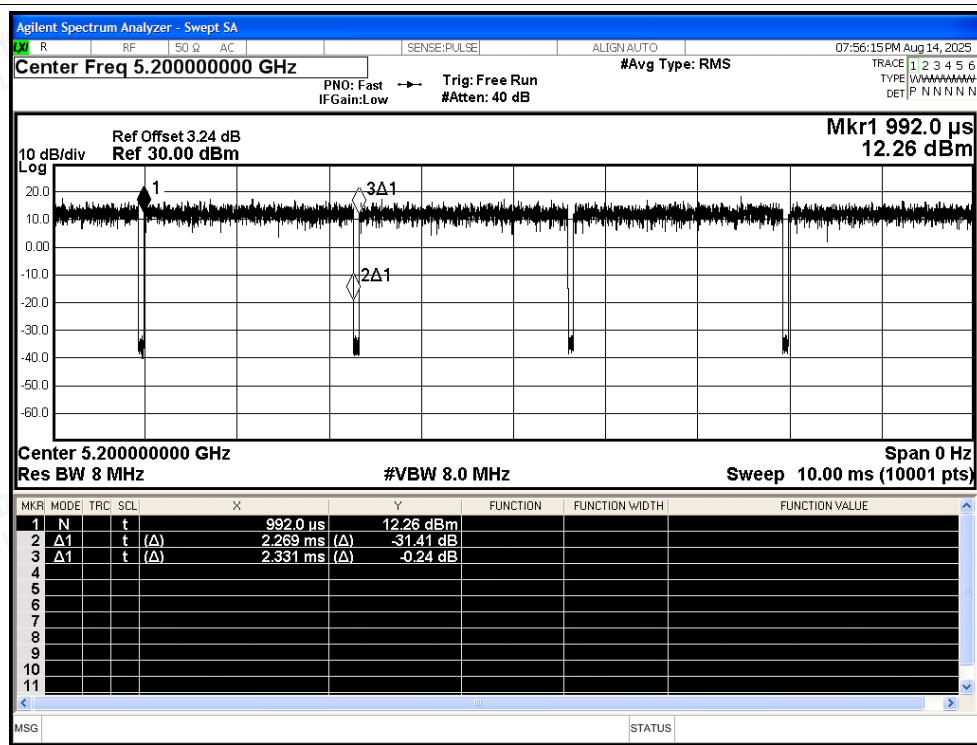

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5240MHz Ant1

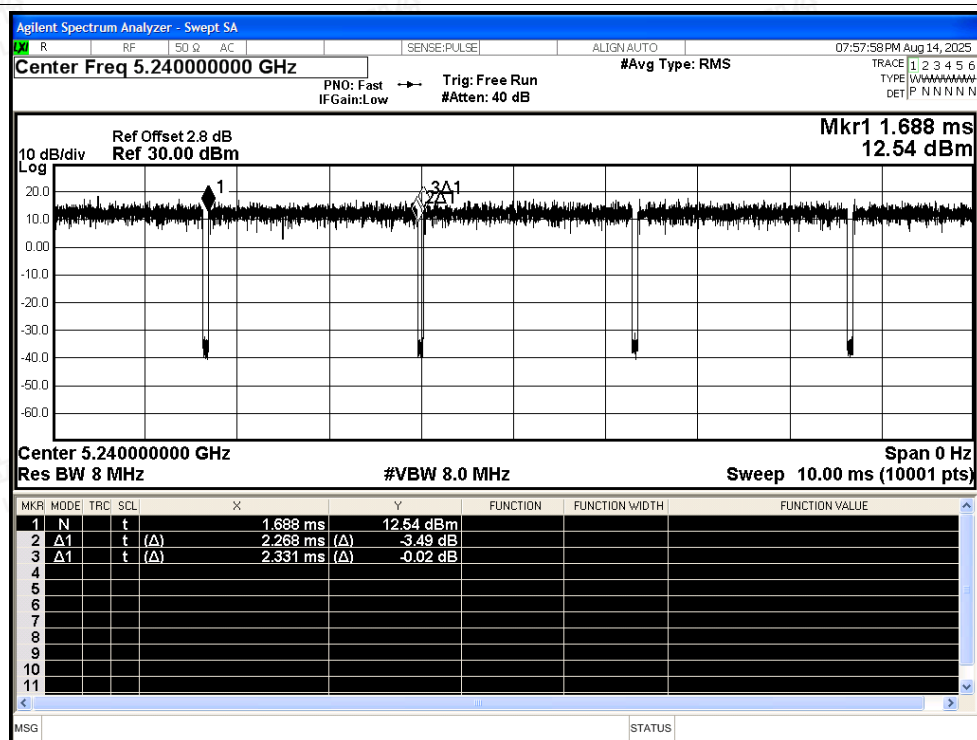

Duty Cycle NVNT ac40 5190MHz Ant1

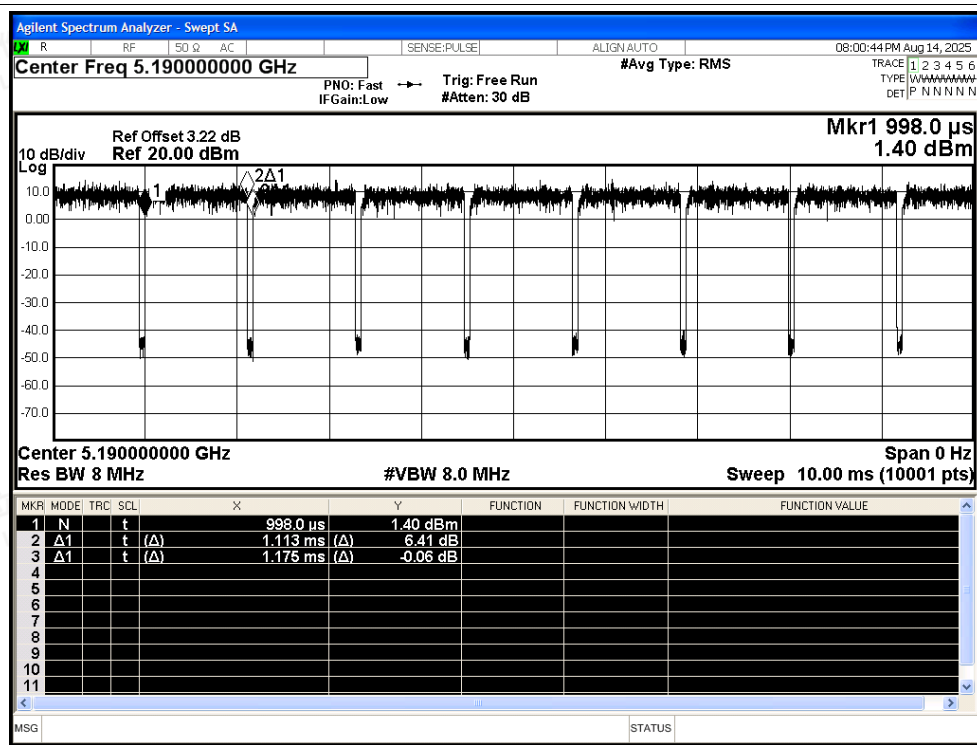

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5230MHz Ant1

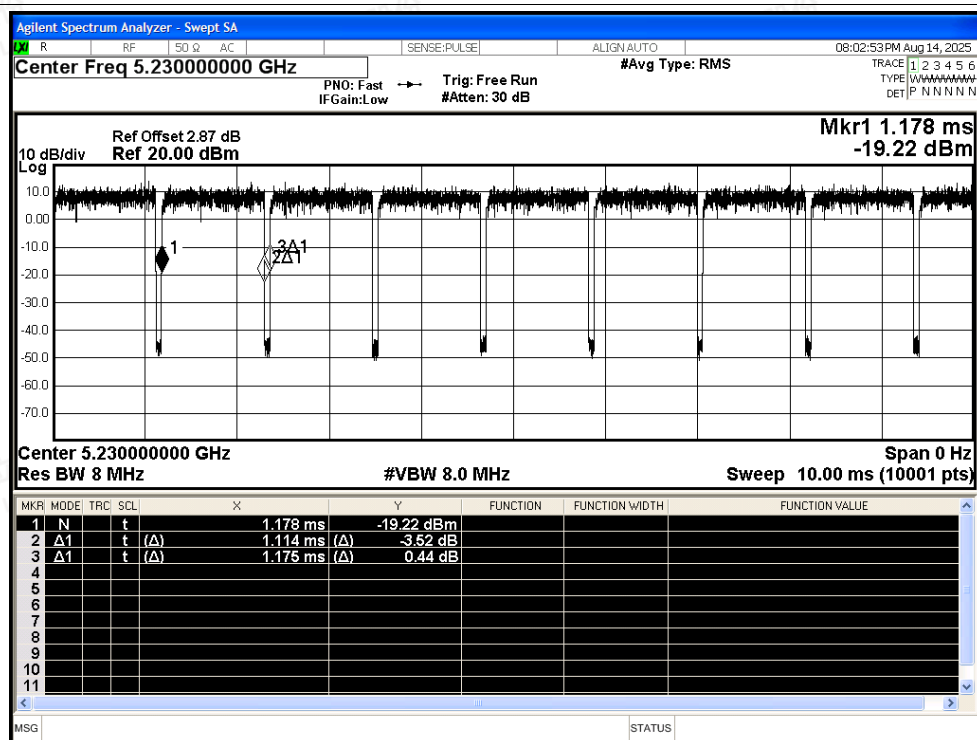

Duty Cycle NVNT ac80 5210MHz Ant1

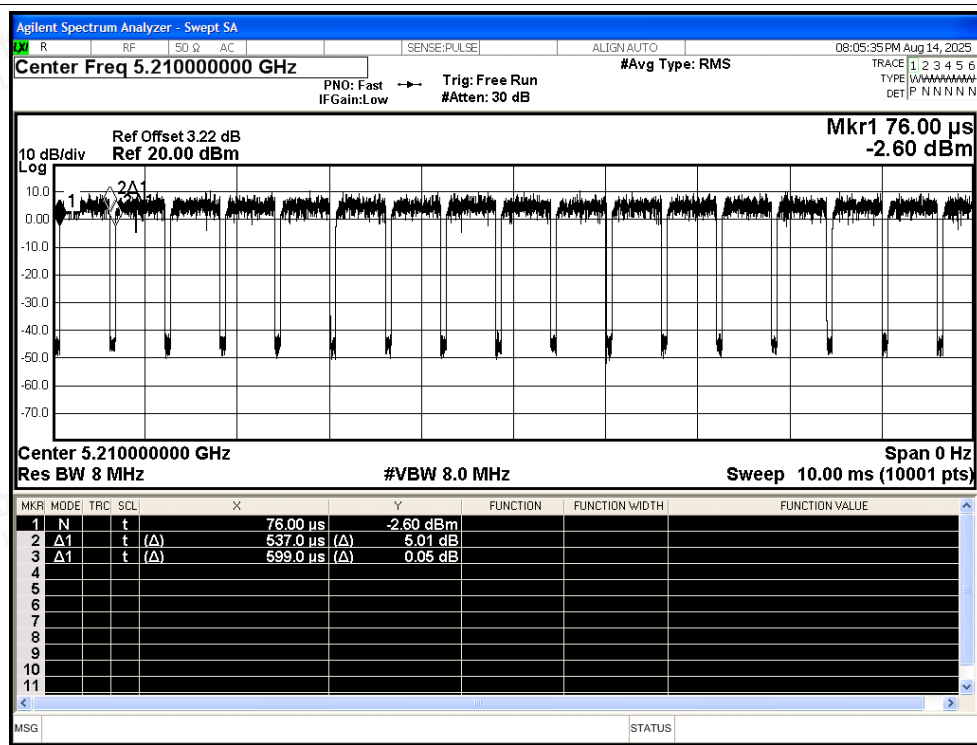

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant2	94.56	0.24	0.91
NVNT	a	5200	Ant2	94.56	0.24	0.91
NVNT	a	5240	Ant2	94.65	0.24	0.91
NVNT	n20	5180	Ant2	97.29	0.12	0.44
NVNT	n20	5200	Ant2	97.33	0.12	0.44
NVNT	n20	5240	Ant2	97.29	0.12	0.44
NVNT	n40	5190	Ant2	94.71	0.24	0.9
NVNT	n40	5230	Ant2	94.71	0.24	0.9
NVNT	ac20	5180	Ant2	97.34	0.12	0.44
NVNT	ac20	5200	Ant2	97.3	0.12	0.44
NVNT	ac20	5240	Ant2	97.34	0.12	0.44
NVNT	ac40	5190	Ant2	94.72	0.24	0.9
NVNT	ac40	5230	Ant2	94.72	0.24	0.9
NVNT	ac80	5210	Ant2	89.82	0.47	1.86






Test Graphs

Duty Cycle NVNT a 5180MHz Ant2

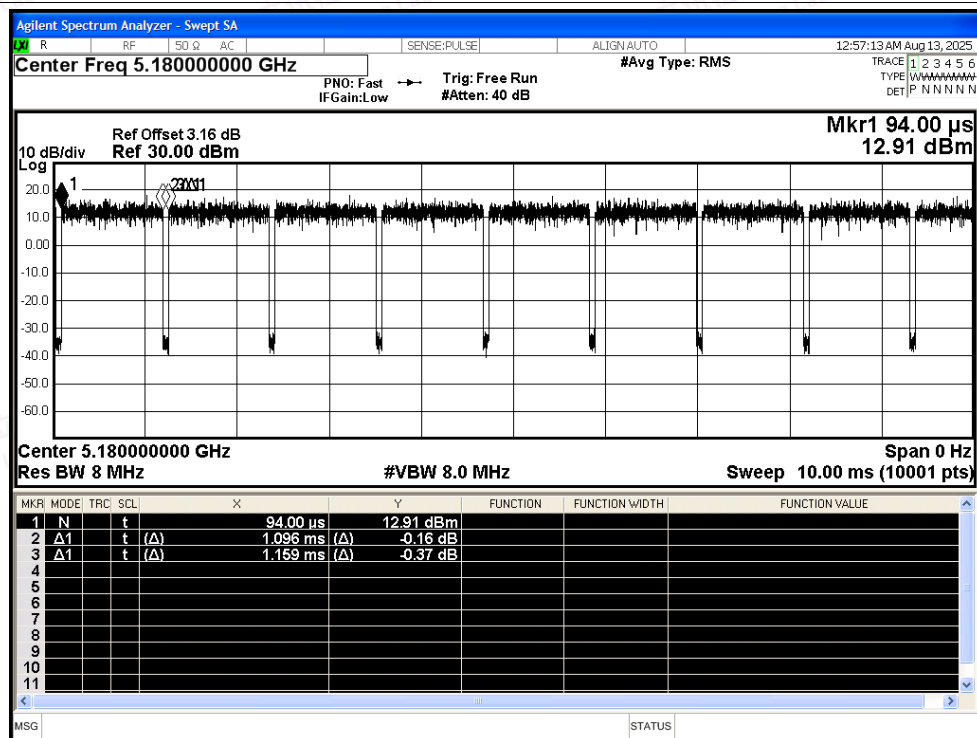

Duty Cycle NVNT a 5200MHz Ant2

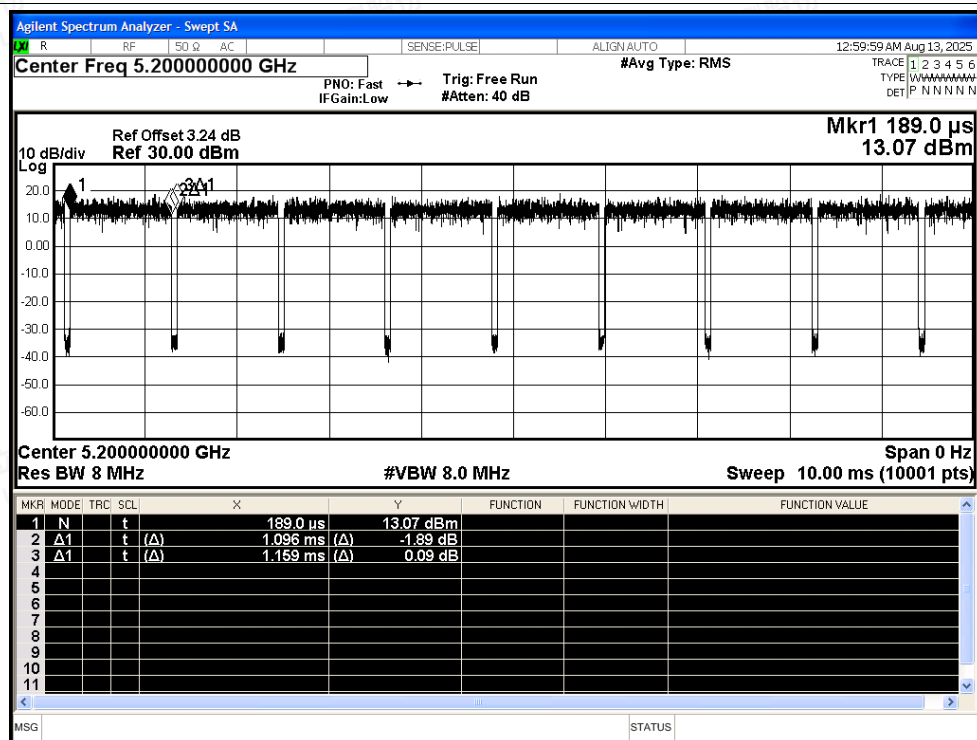

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5240MHz Ant2

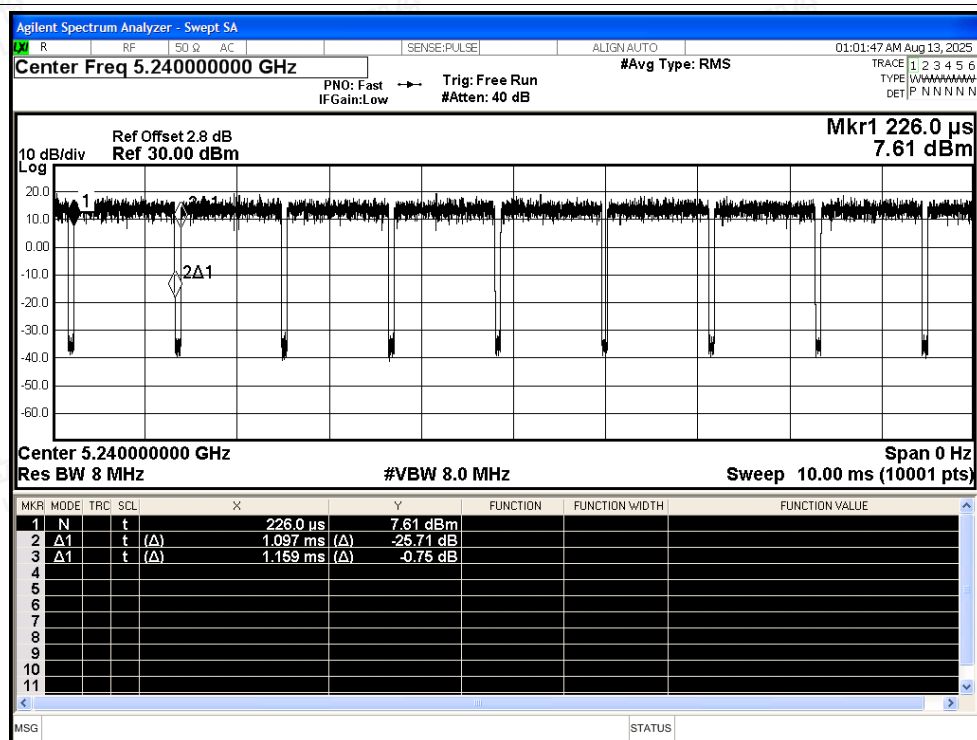

Duty Cycle NVNT n20 5180MHz Ant2

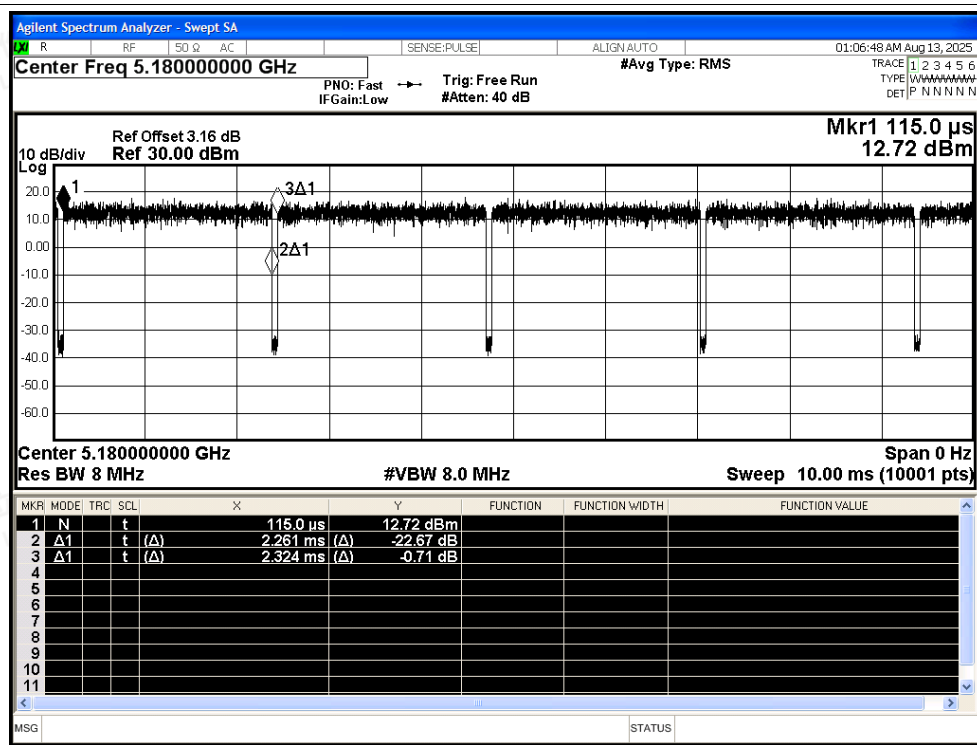

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5200MHz Ant2

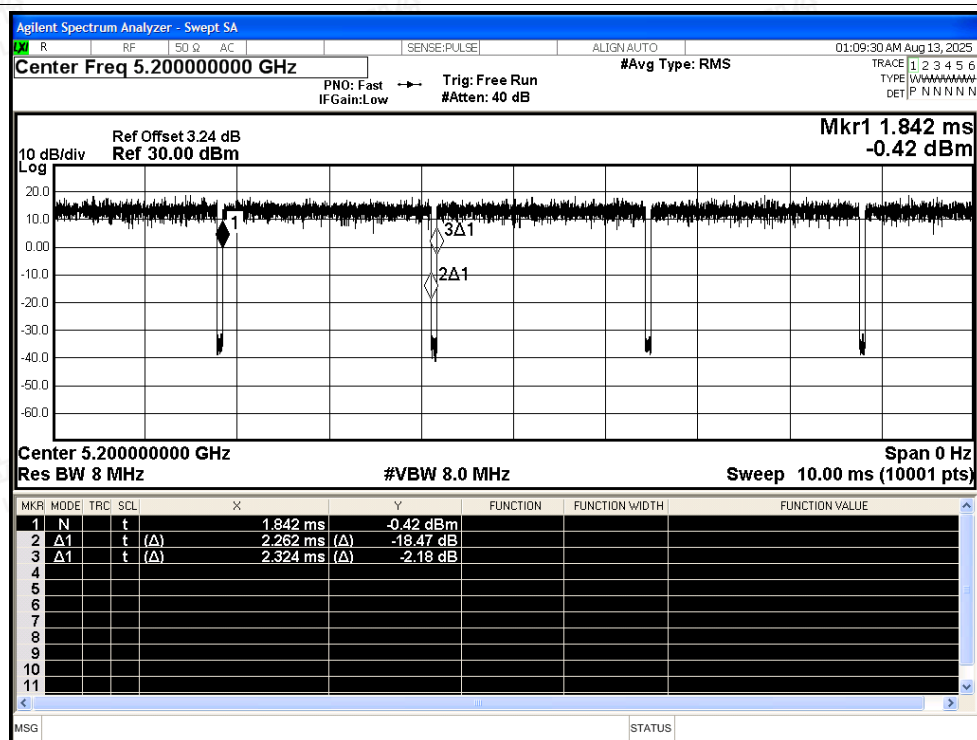

Duty Cycle NVNT n20 5240MHz Ant2

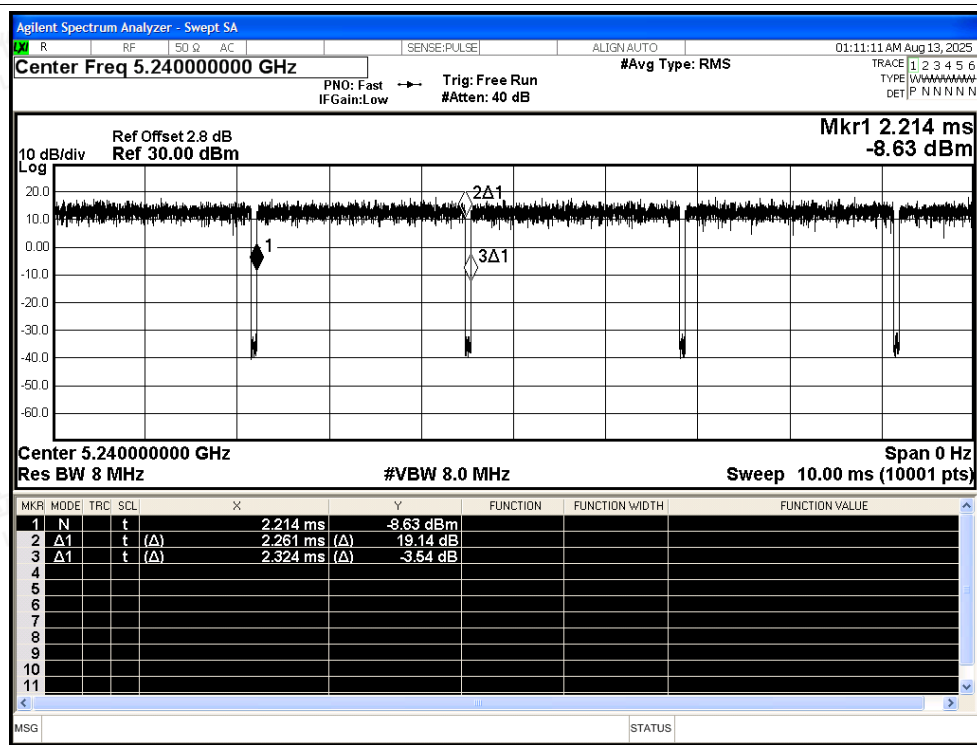

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5190MHz Ant2

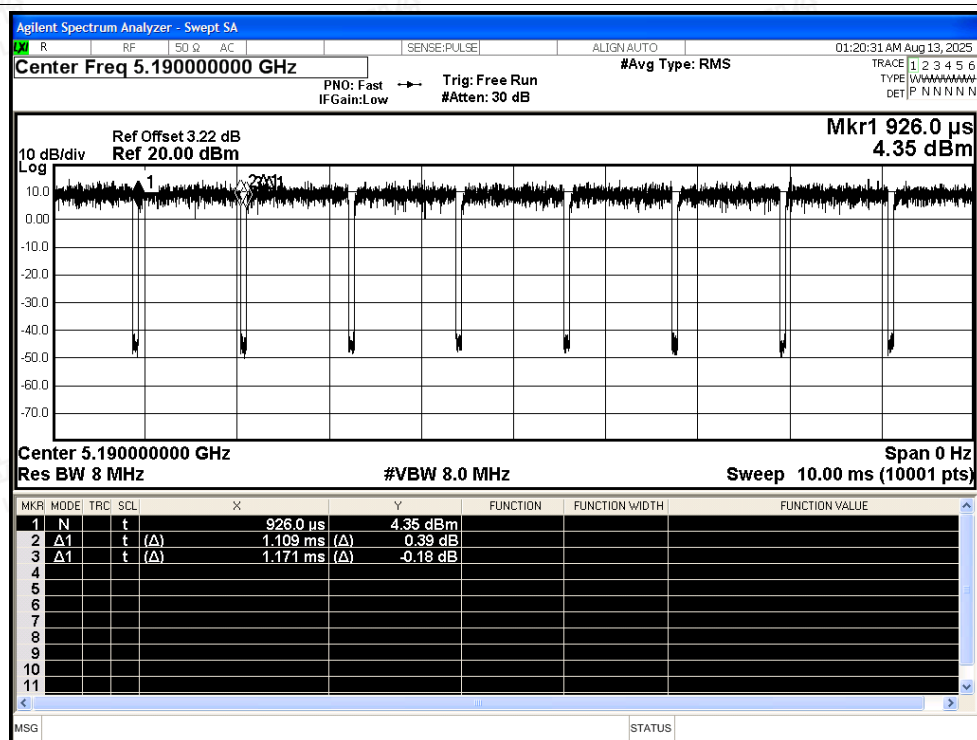

Duty Cycle NVNT n40 5230MHz Ant2

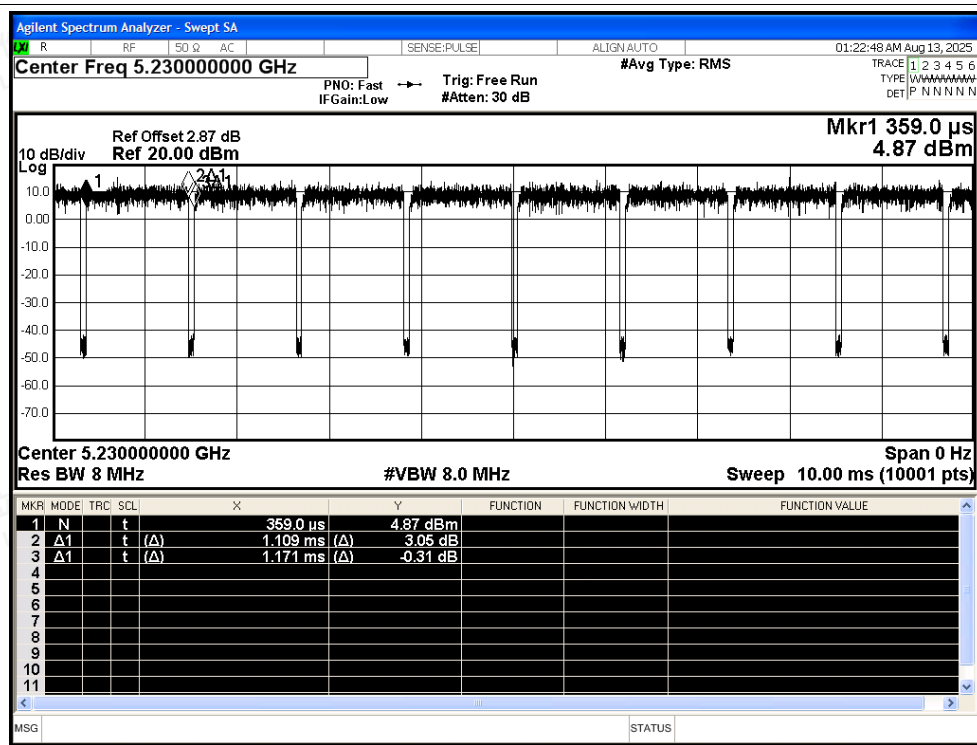

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5180MHz Ant2

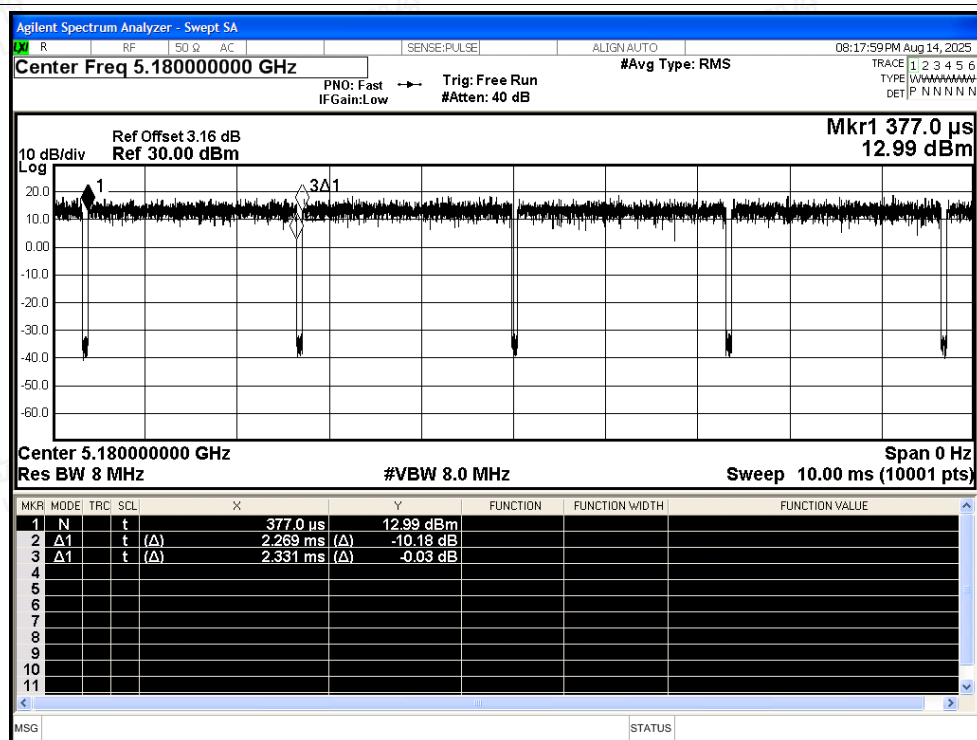

Duty Cycle NVNT ac20 5200MHz Ant2

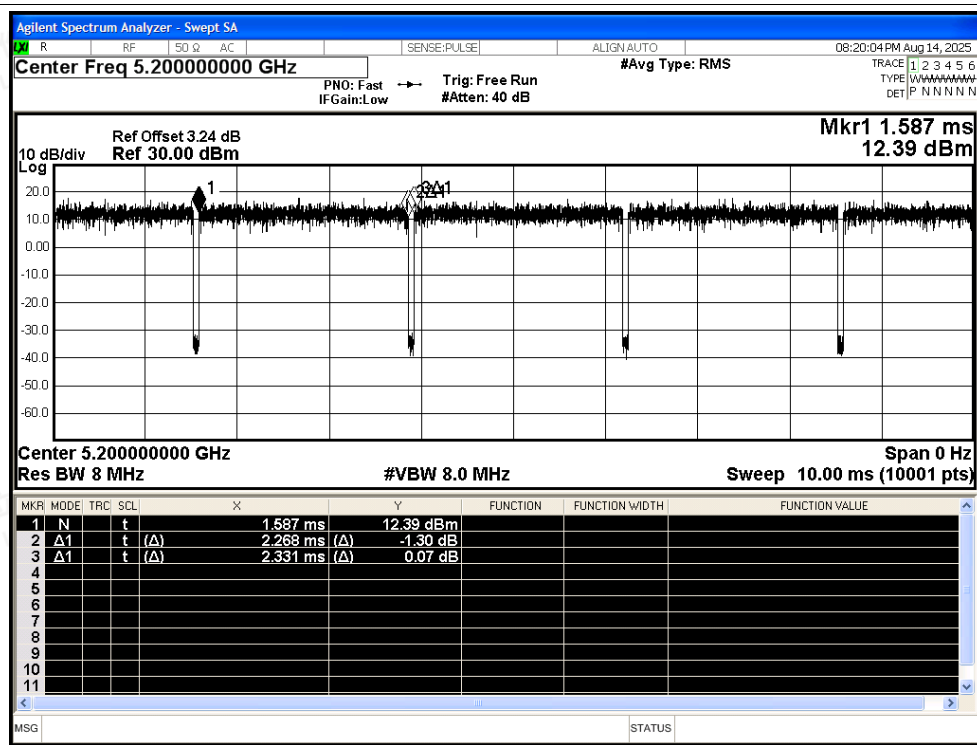

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5240MHz Ant2

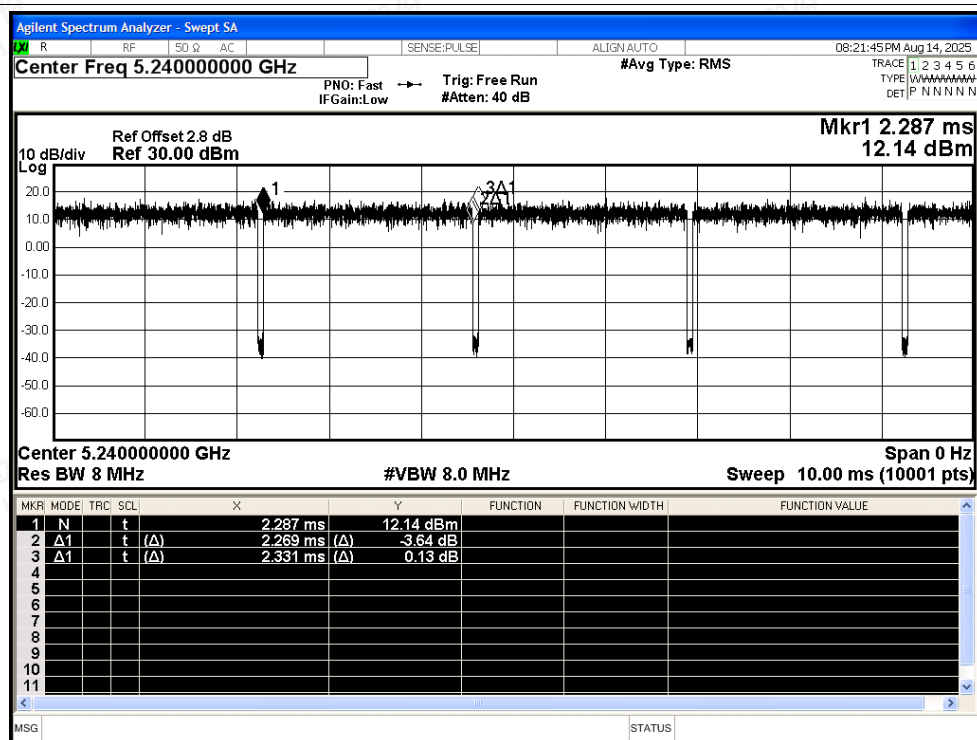

Duty Cycle NVNT ac40 5190MHz Ant2

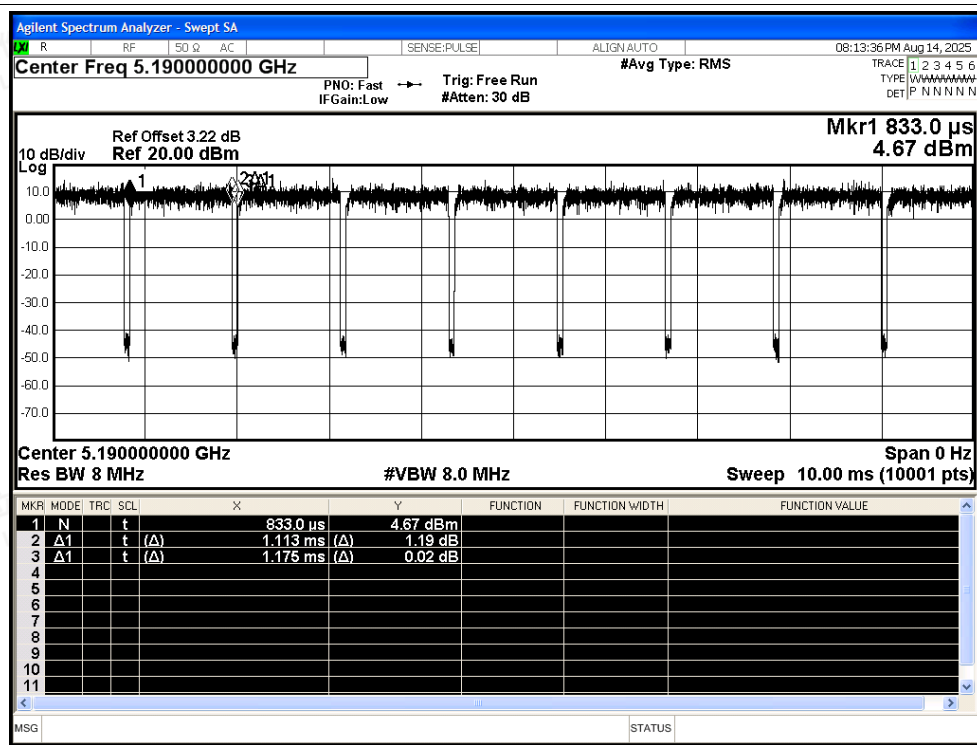

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5230MHz Ant2

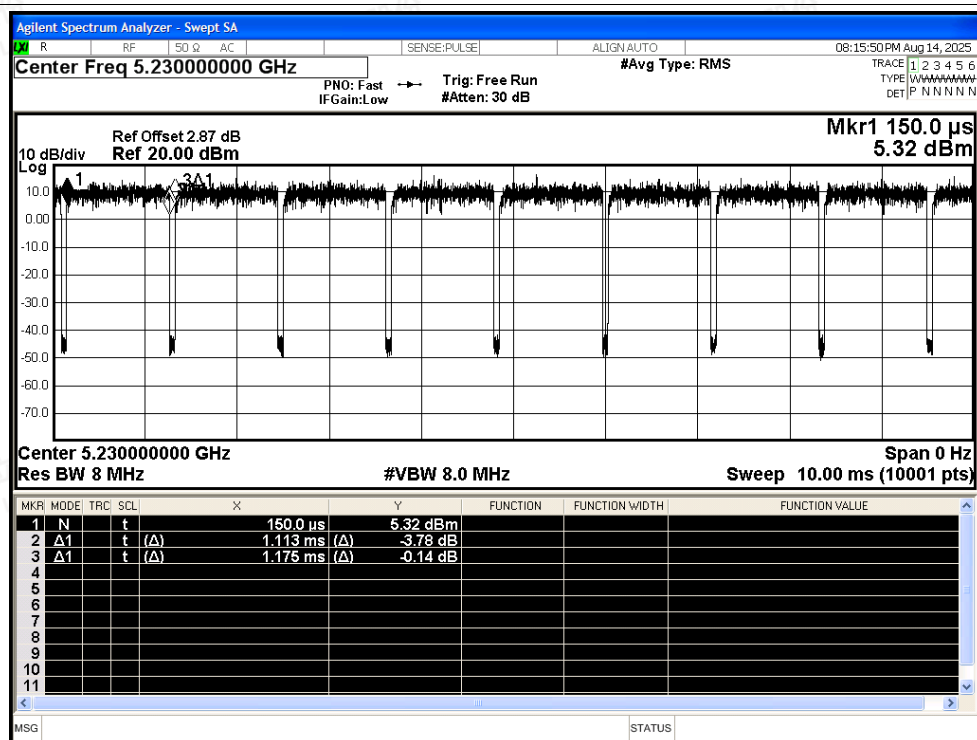

Duty Cycle NVNT ac80 5210MHz Ant2

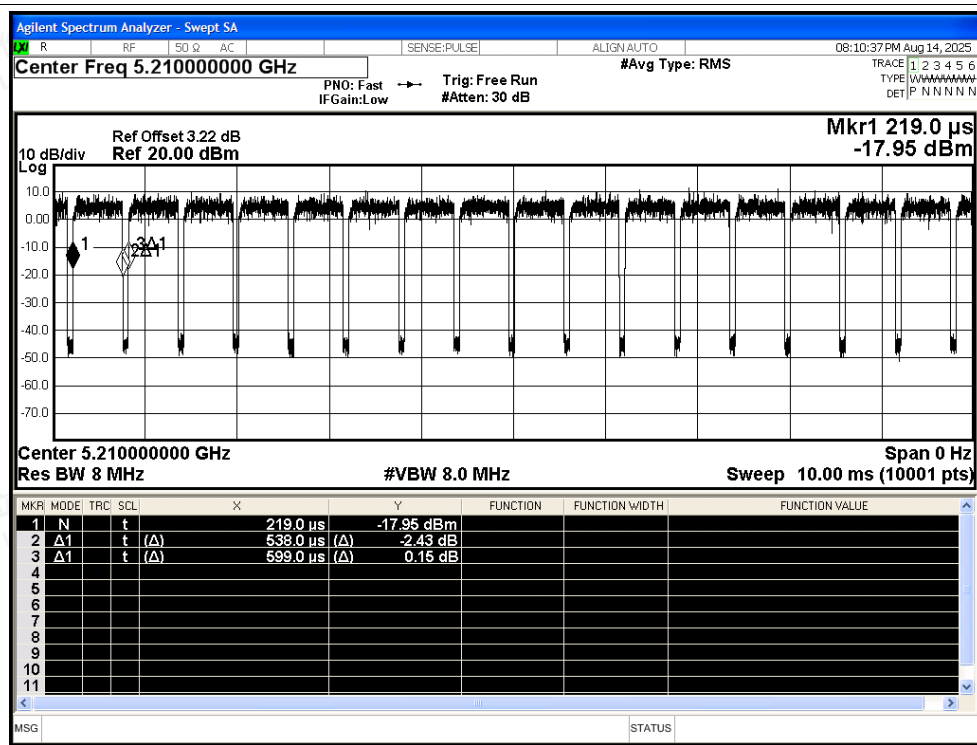

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity