





Restrict Band NVNT a 5700MHz Ant2 Peak

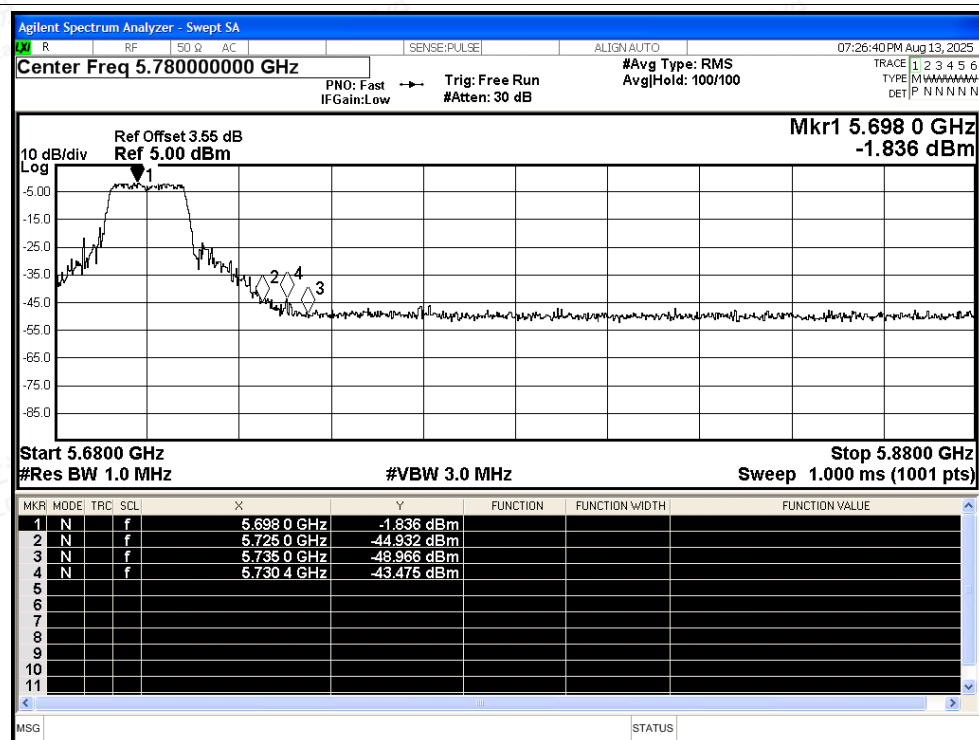

Restrict Band NVNT a 5700MHz Ant2 Average

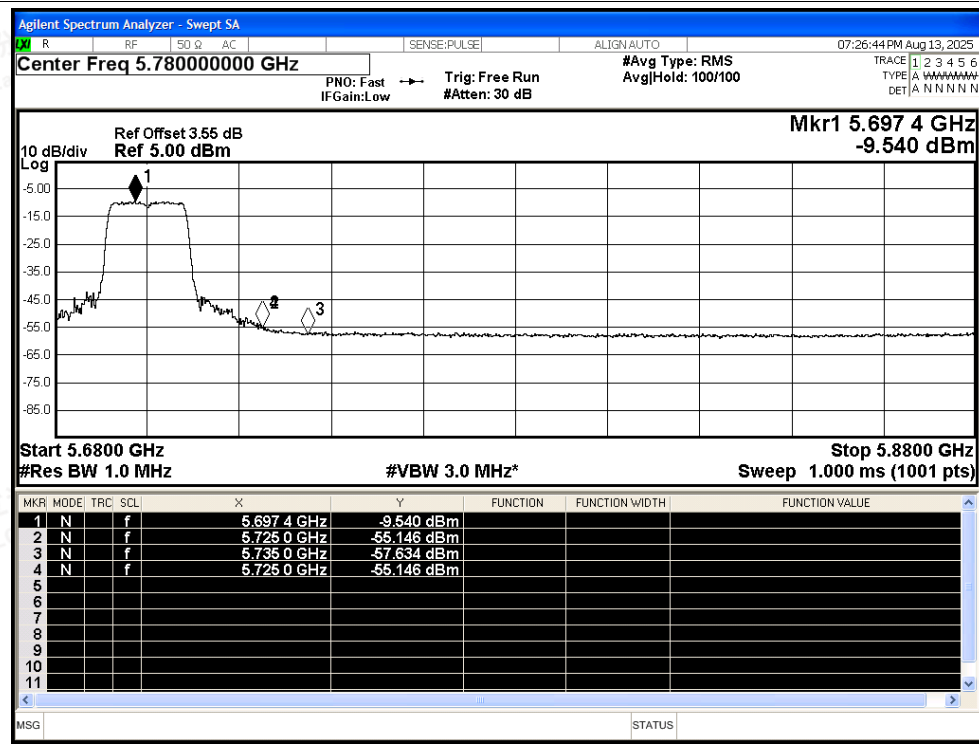

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5500MHz Ant2 Peak

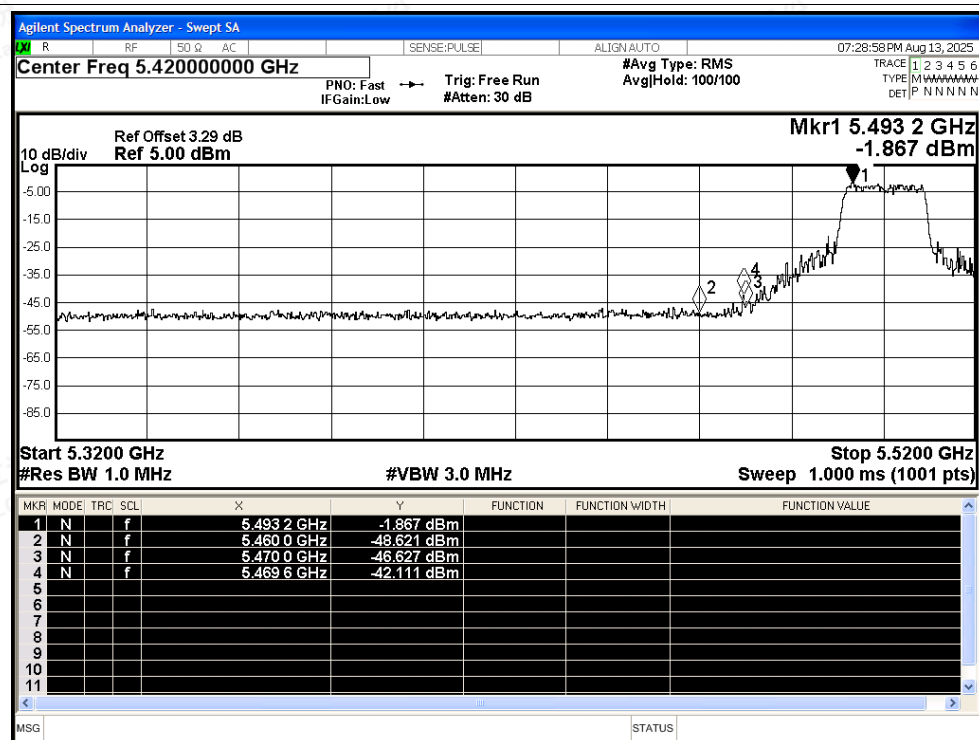

Restrict Band NVNT n20 5500MHz Ant2 Average

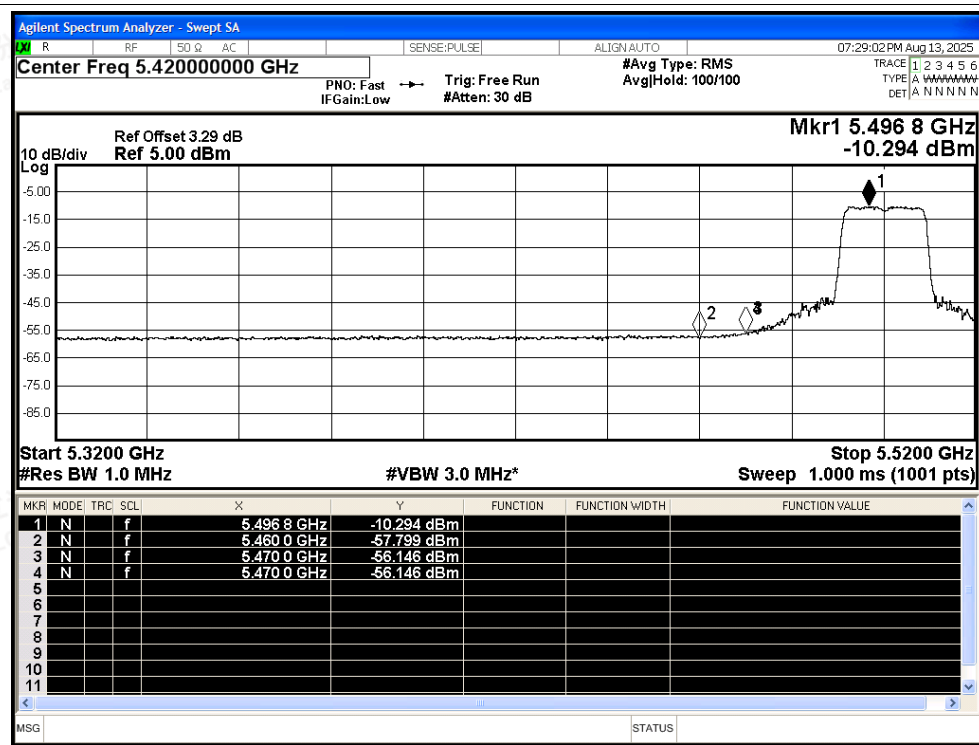

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5700MHz Ant2 Peak

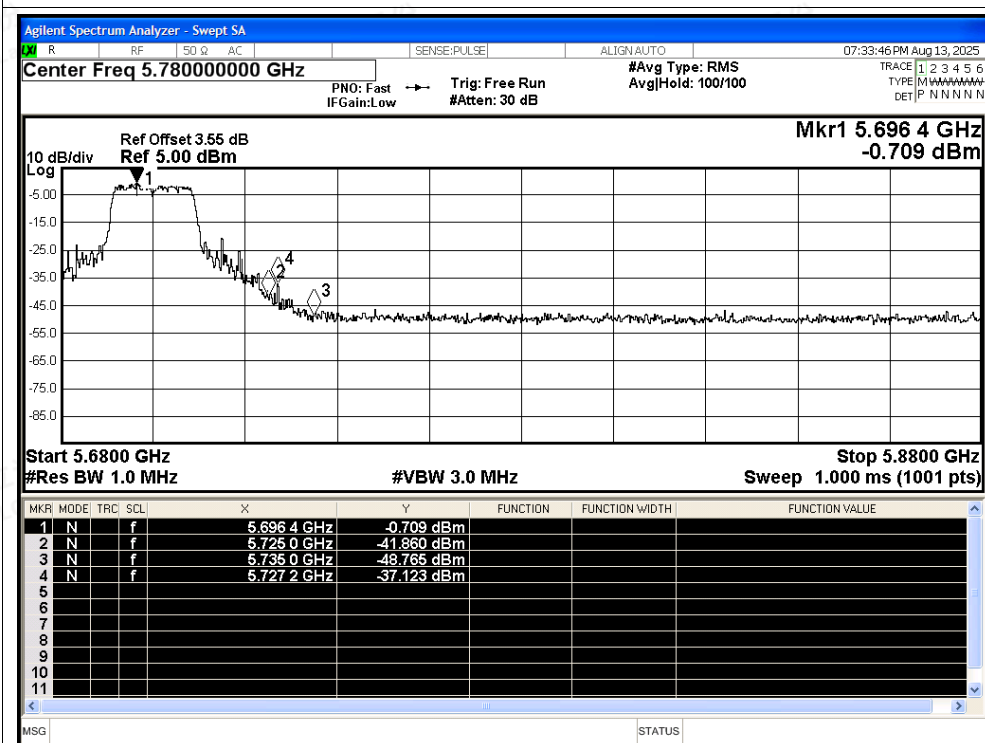

Restrict Band NVNT n20 5700MHz Ant2 Average

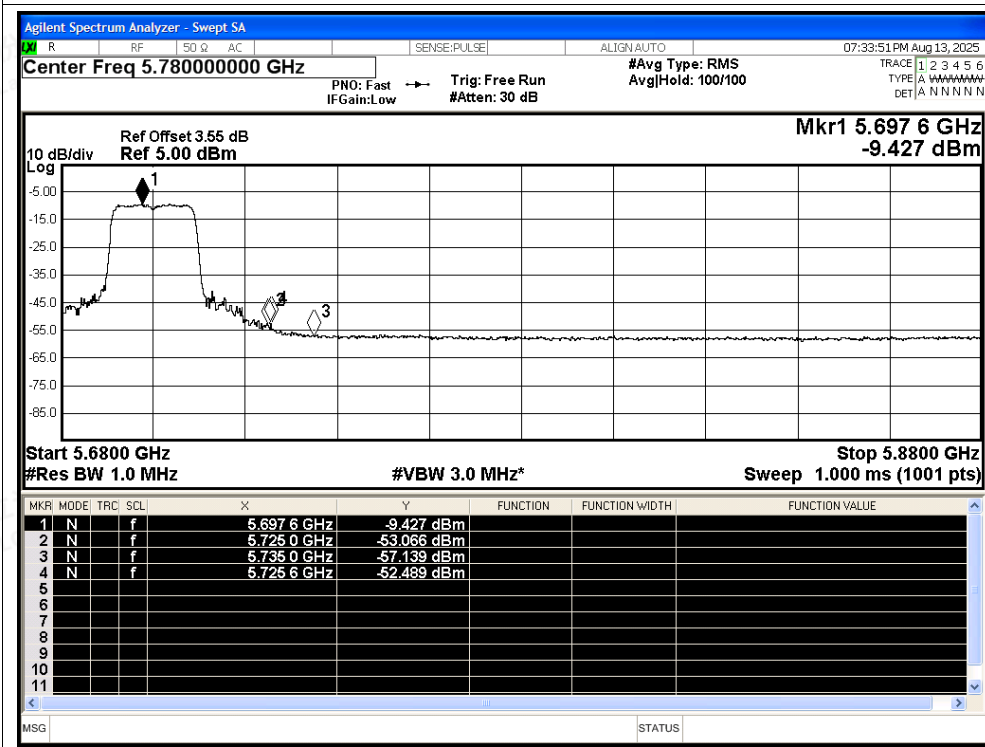

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5510MHz Ant2 Peak

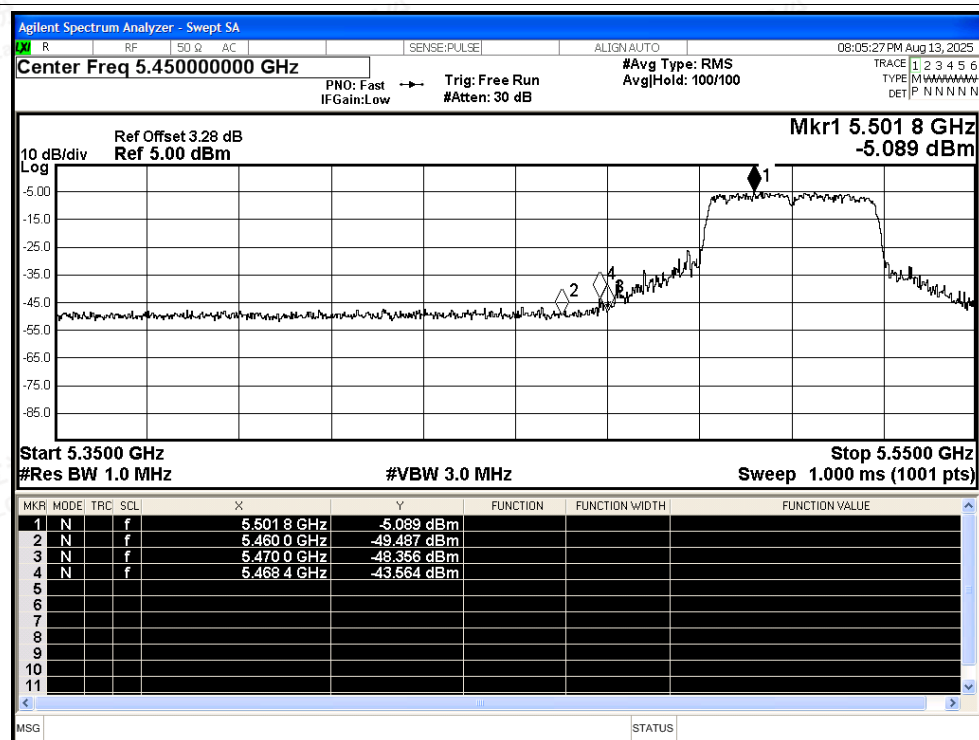

Restrict Band NVNT n40 5510MHz Ant2 Average

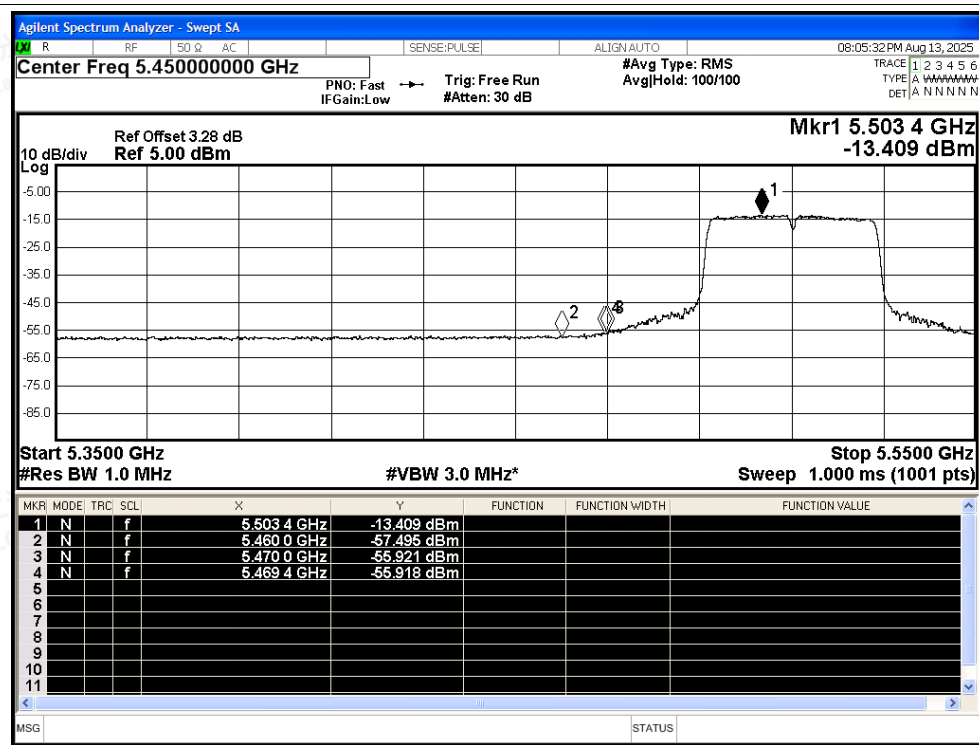

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5670MHz Ant2 Peak

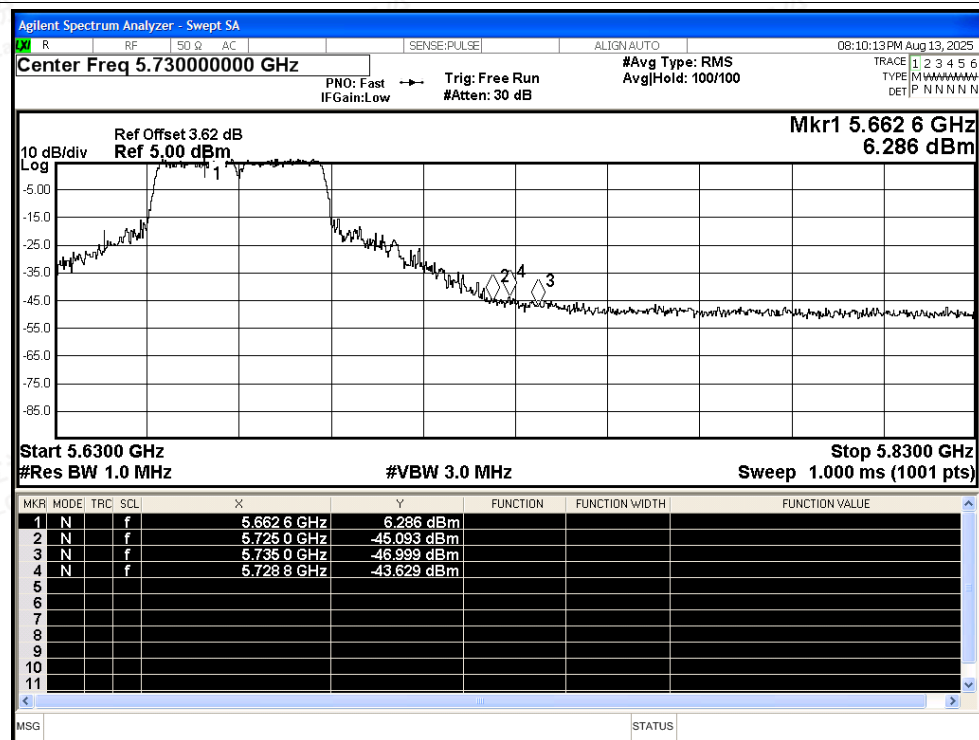

Restrict Band NVNT n40 5670MHz Ant2 Average

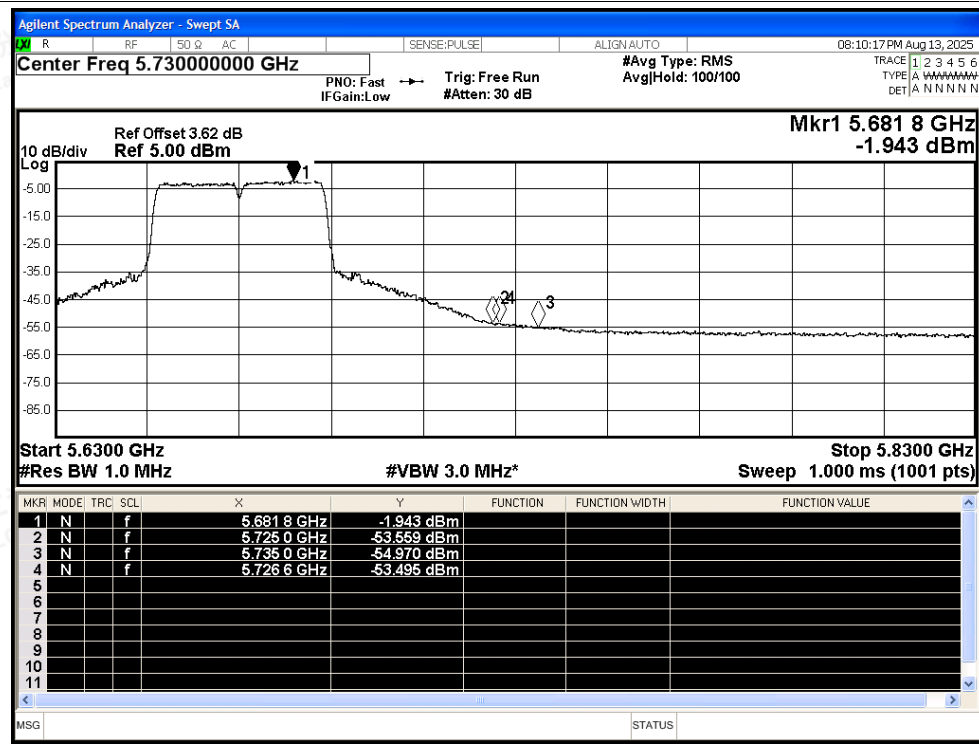

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5500MHz Ant2 Peak

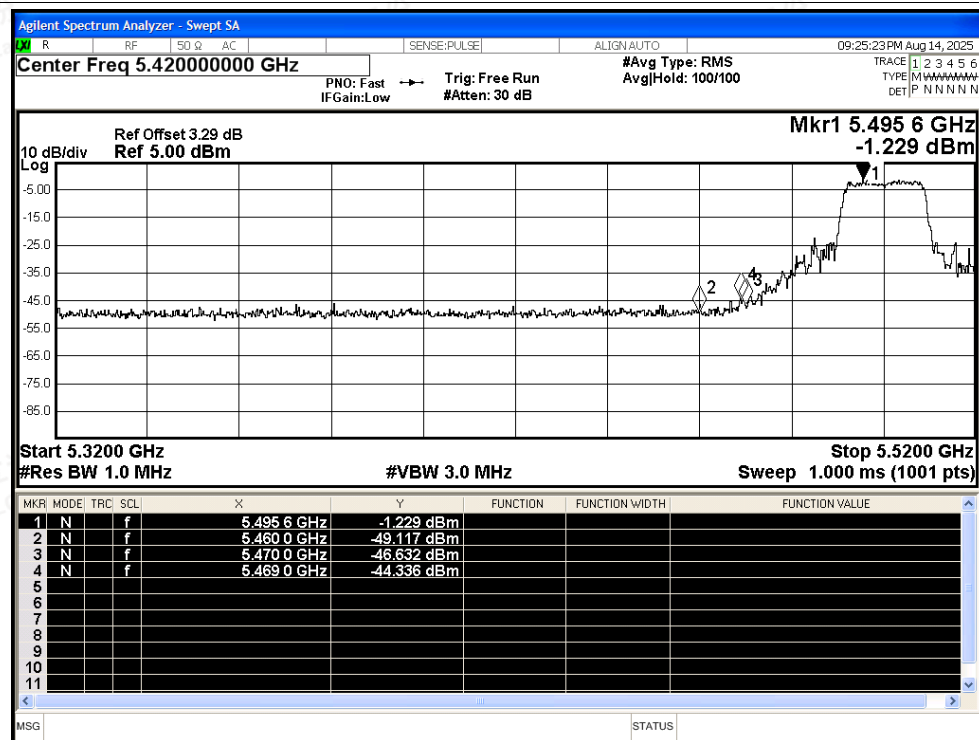

Restrict Band NVNT ac20 5500MHz Ant2 Average

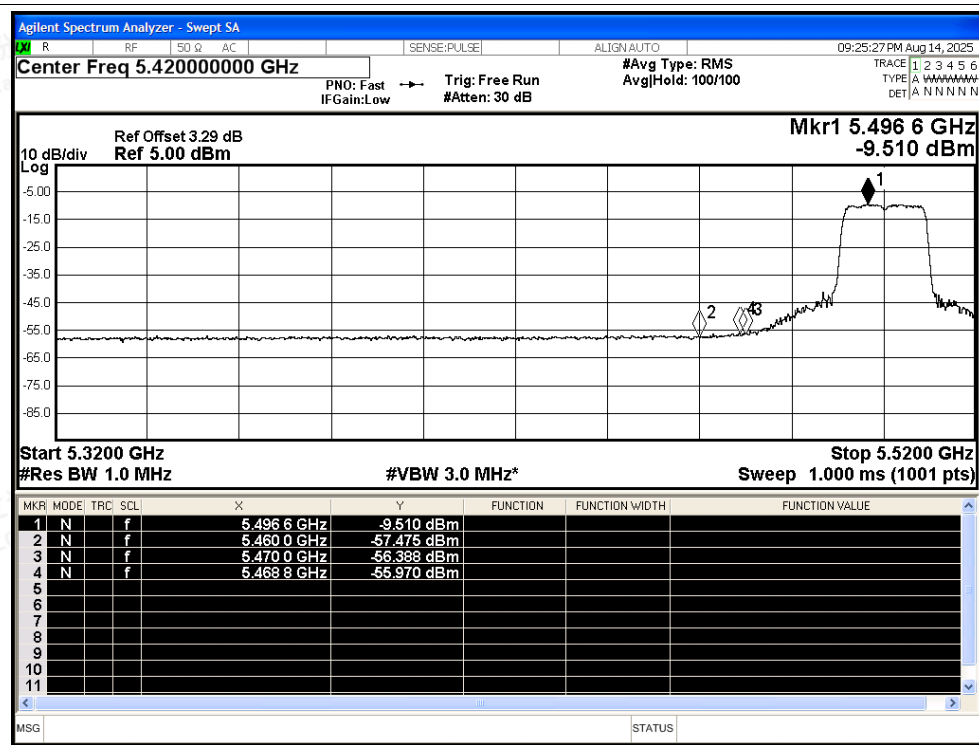

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5700MHz Ant2 Peak

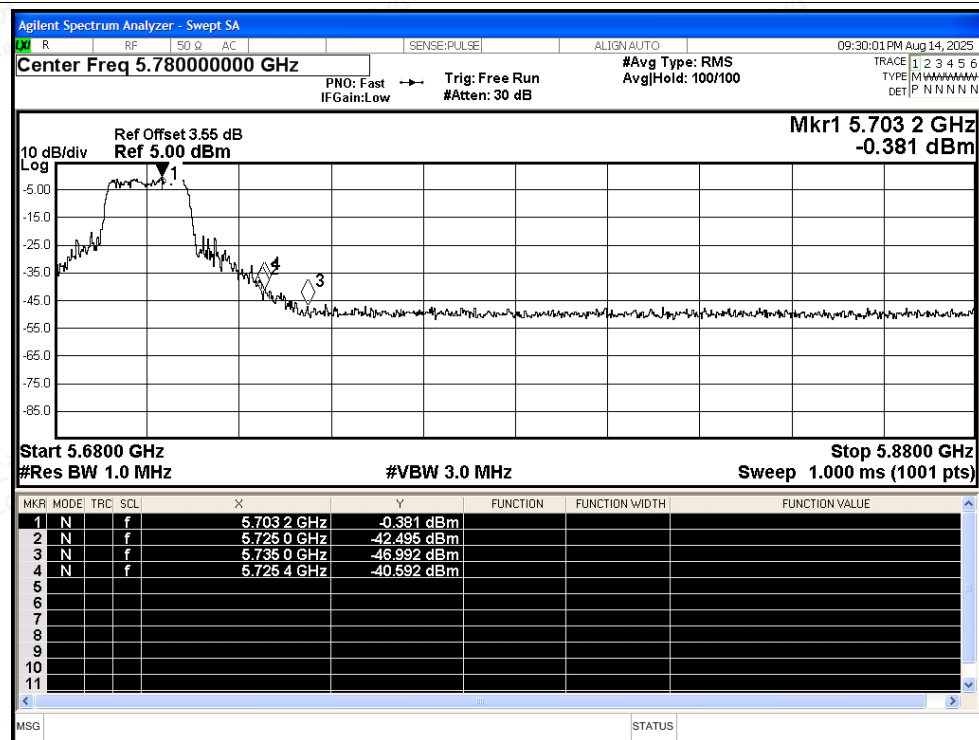

Restrict Band NVNT ac20 5700MHz Ant2 Average

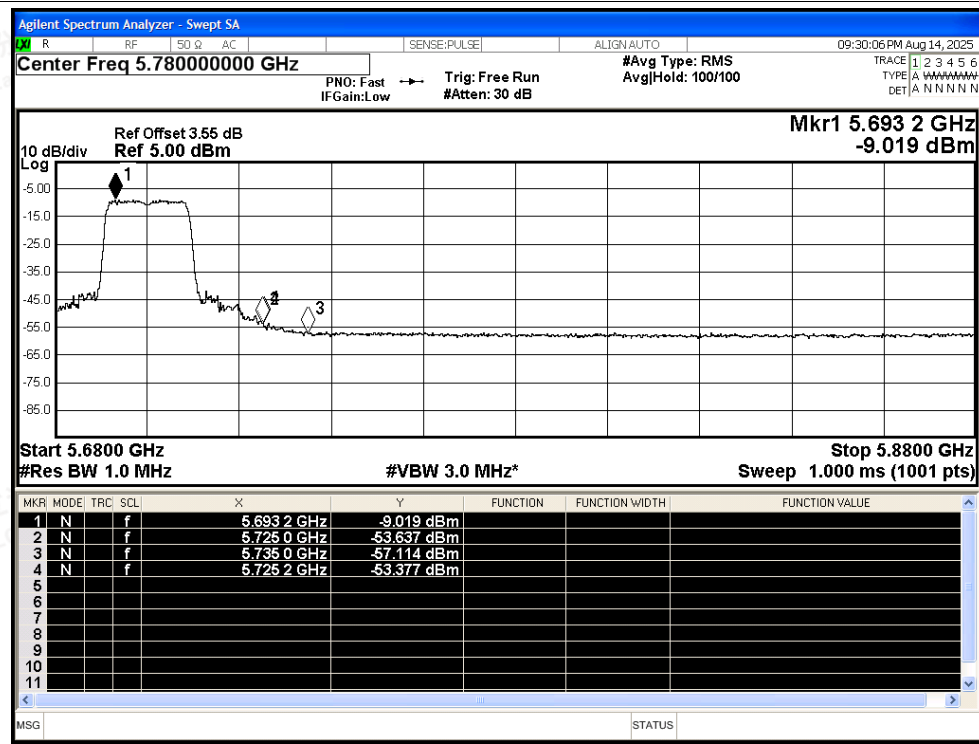

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5510MHz Ant2 Peak

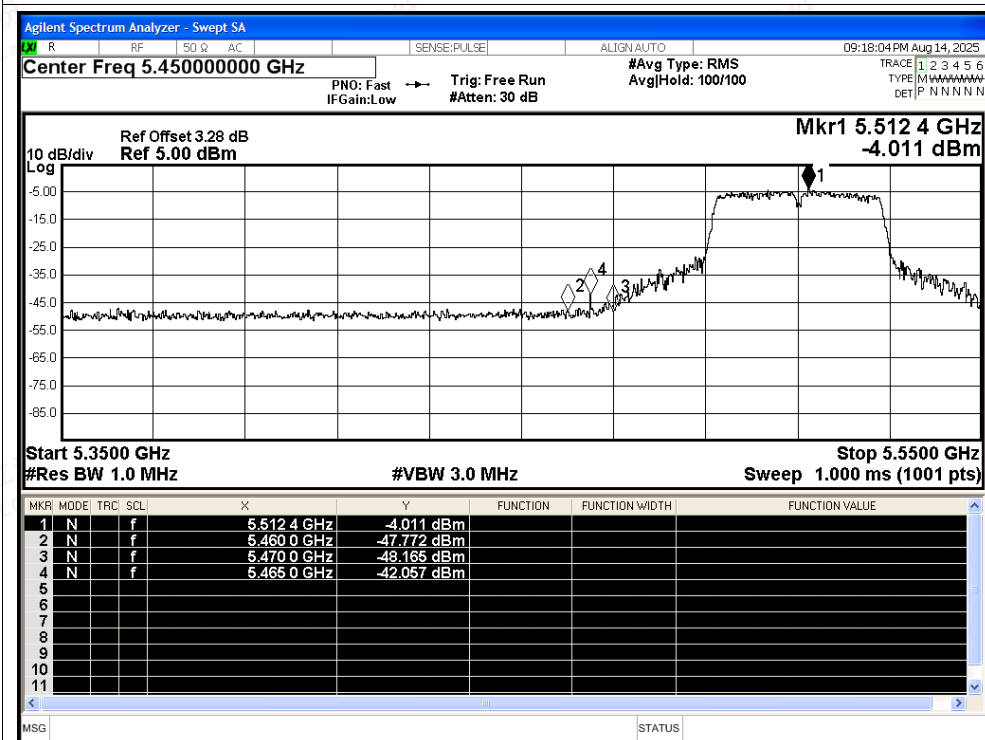

Restrict Band NVNT ac40 5510MHz Ant2 Average

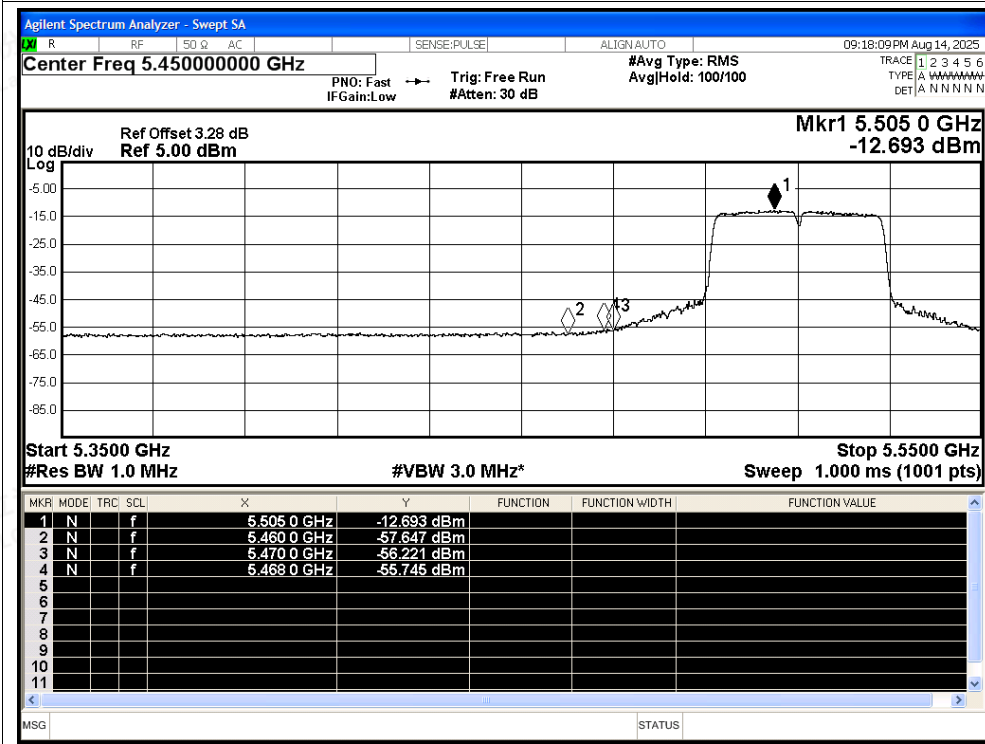

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5670MHz Ant2 Peak

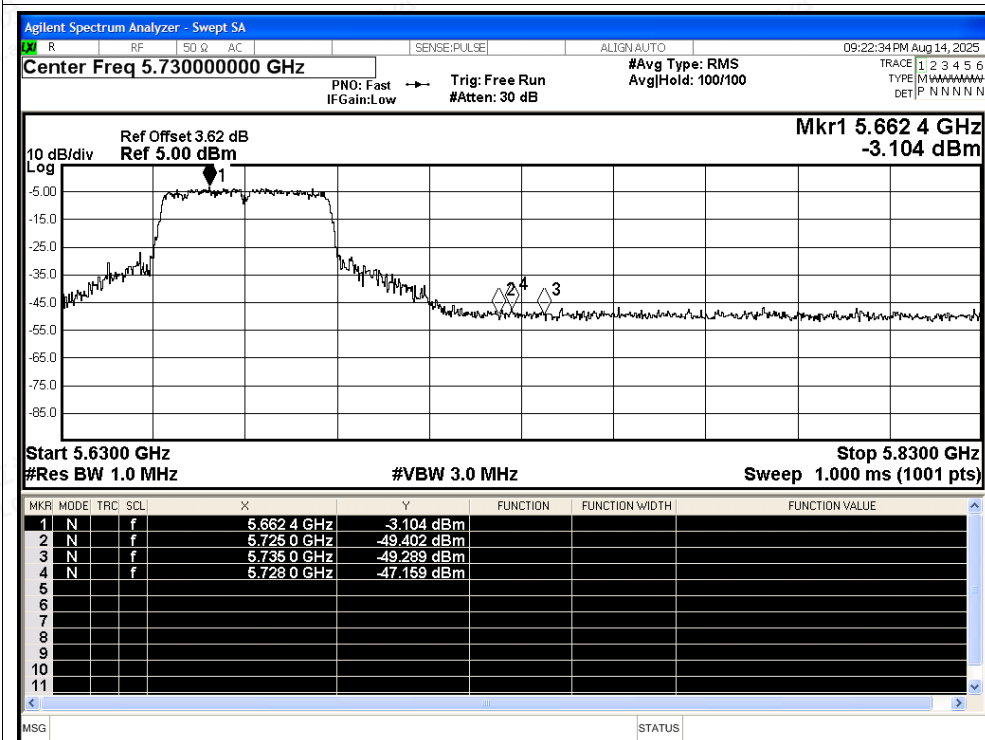

Restrict Band NVNT ac40 5670MHz Ant2 Average

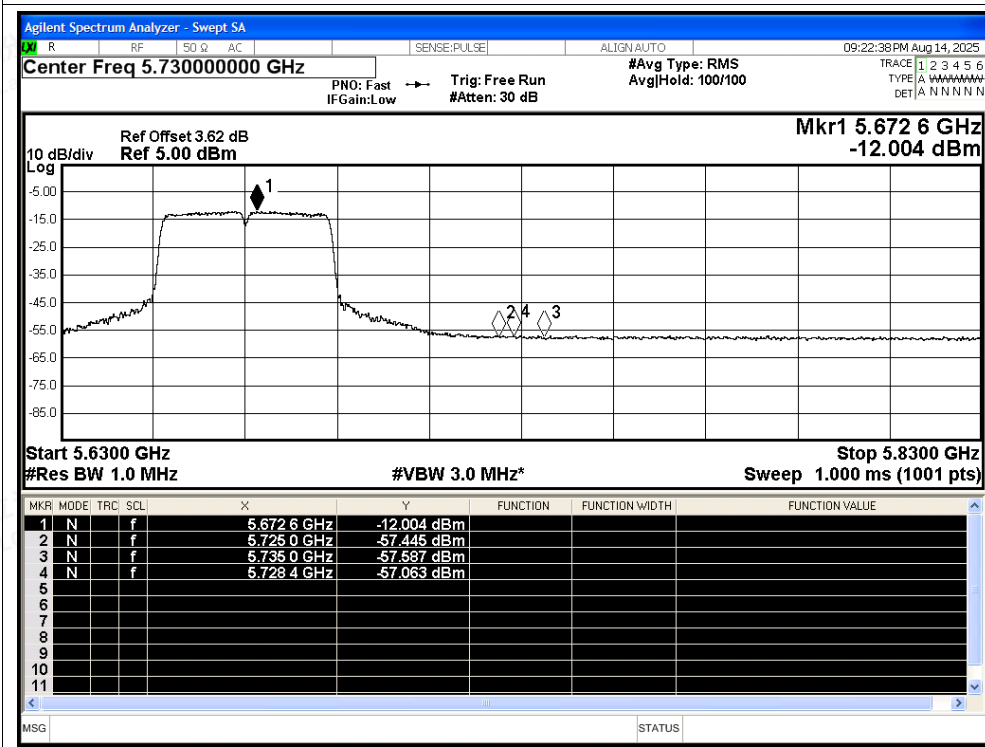

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5530MHz Ant2 Peak

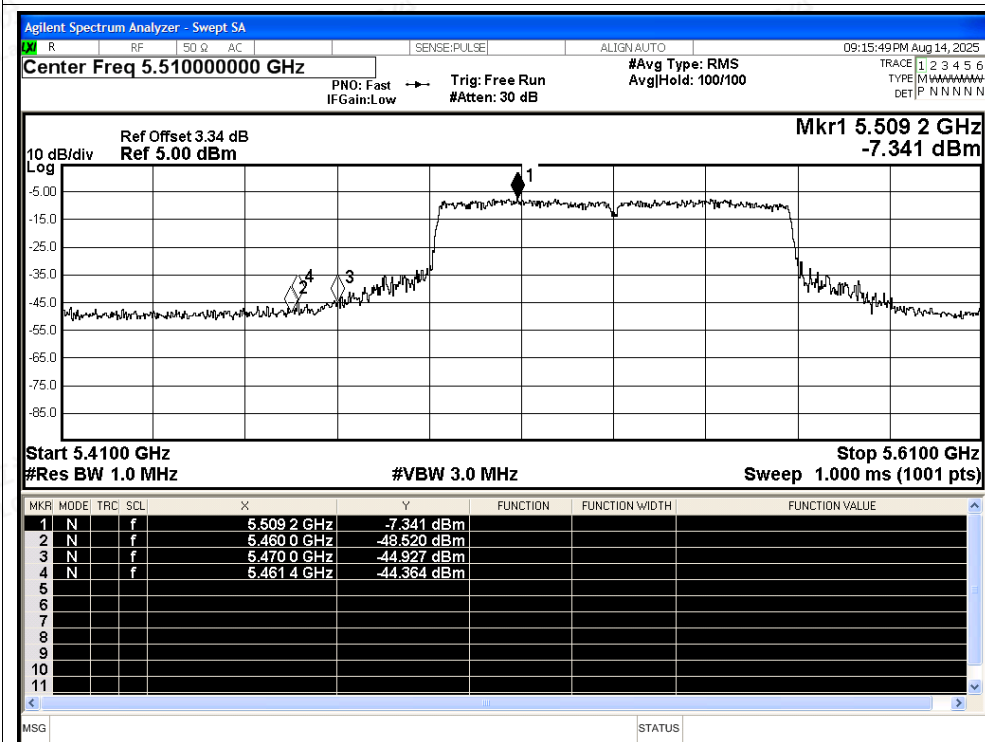

Restrict Band NVNT ac80 5530MHz Ant2 Average

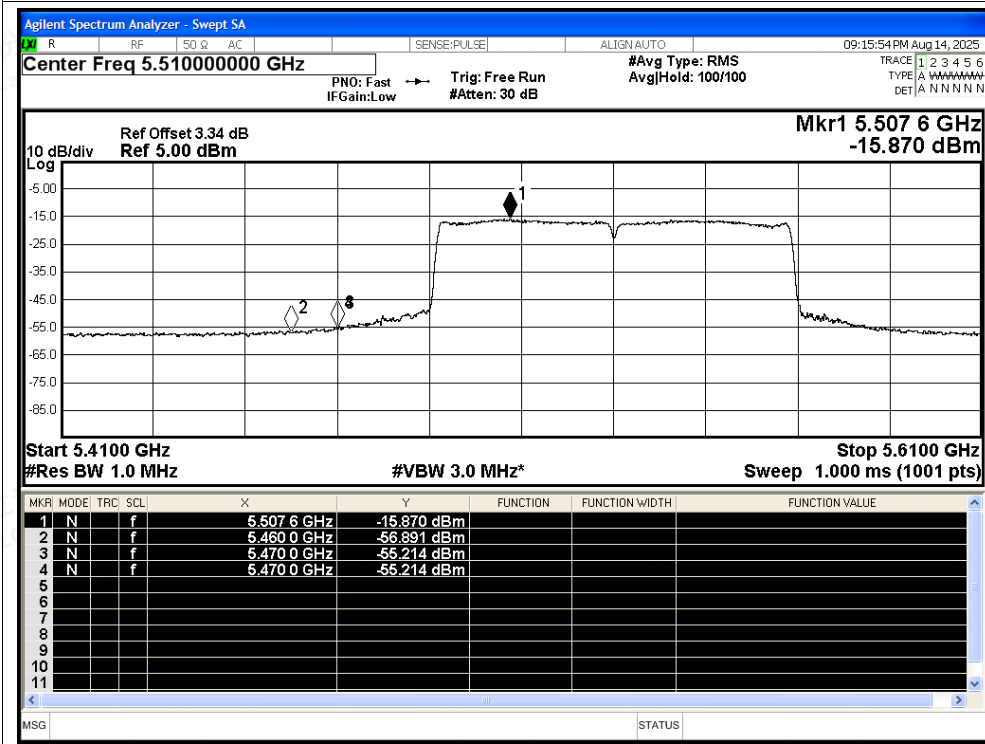

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5610MHz Ant2 Peak

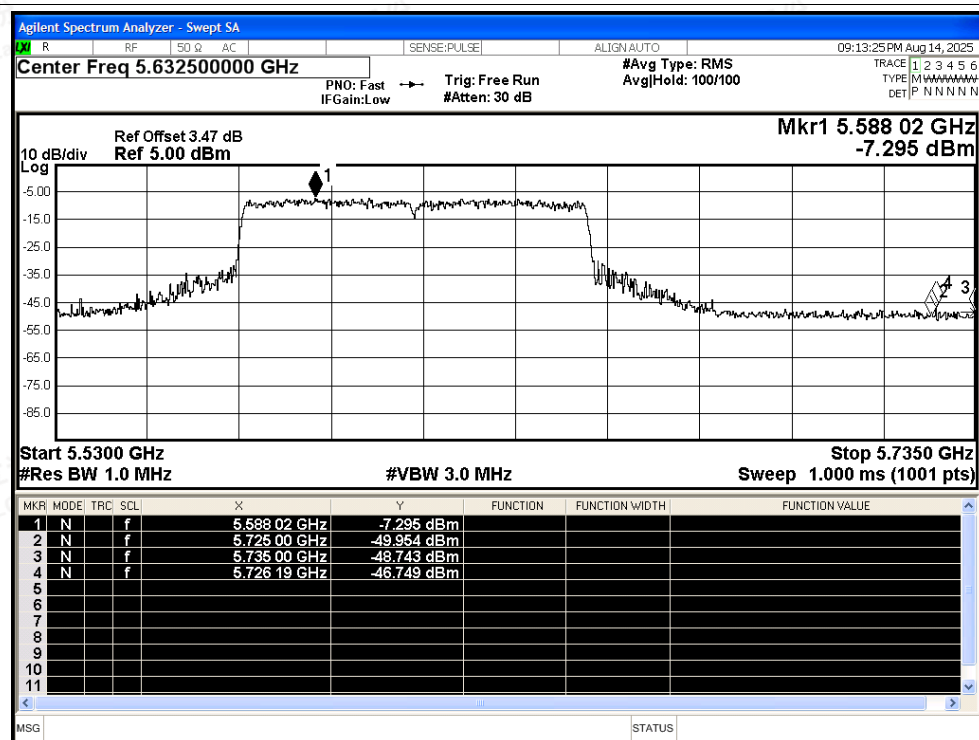

Restrict Band NVNT ac80 5610MHz Ant2 Average

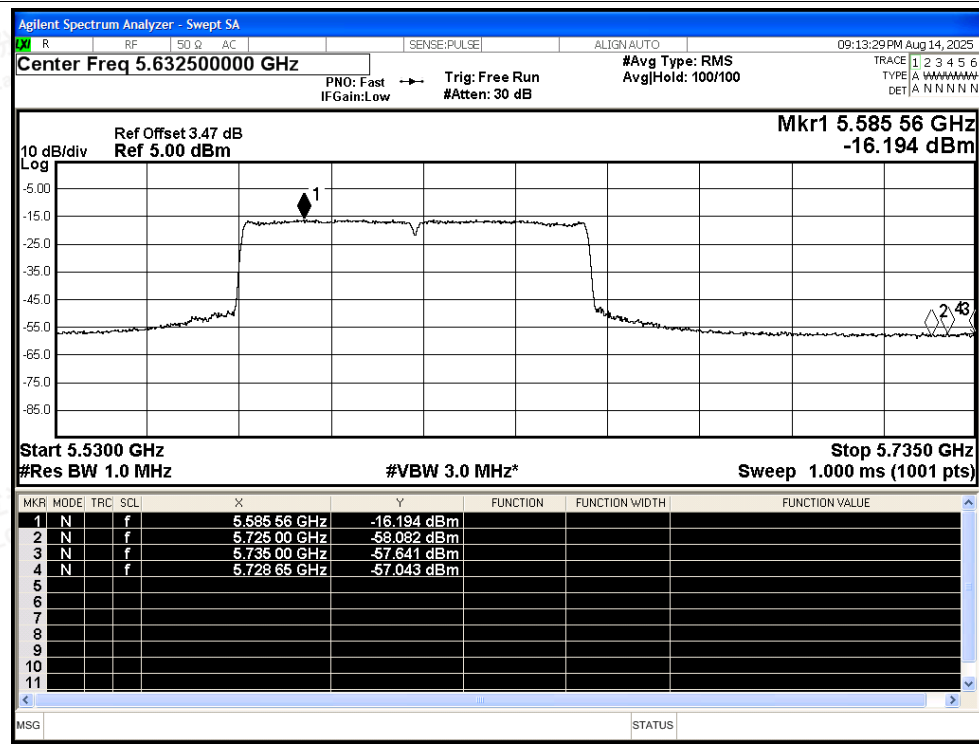

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant1 Power (dBm)	Ant2 Power (dBm)	Sum (Ant1+Ant2)	Gain (dBi)	Total E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5500	-49.09	-48.62	-45.84	5.39	54.78	Peak	68.2	Pass
NVNT	n20	5500	-57.81	-57.8	-54.79	5.39	45.82	Average	54	Pass
NVNT	n20	5500	-42.3	-42.11	-39.19	5.39	61.42	Peak	68.2	Pass
NVNT	n20	5500	-55.55	-56.15	-52.83	5.39	47.79	Average	54	Pass
NVNT	n20	5500	-46.1	-46.63	-43.35	5.39	57.27	Peak	68.2	Pass
NVNT	n20	5500	-55.55	-56.15	-52.83	5.39	47.79	Average	54	Pass
NVNT	n20	5700	-39.54	-41.86	-37.54	5.39	63.08	Peak	68.2	Pass
NVNT	n20	5700	-54.56	-53.07	-50.74	5.39	49.88	Average	54	Pass
NVNT	n20	5700	-38.99	-37.12	-34.94	5.39	65.67	Peak	68.2	Pass
NVNT	n20	5700	-53.44	-52.49	-49.93	5.39	50.69	Average	54	Pass
NVNT	n20	5700	-48.78	-48.77	-45.76	5.39	54.85	Peak	68.2	Pass
NVNT	n20	5700	-56.63	-57.14	-53.87	5.39	46.75	Average	54	Pass
NVNT	n40	5510	-49.5	-49.49	-46.48	5.39	54.13	Peak	68.2	Pass
NVNT	n40	5510	-57.46	-57.5	-54.47	5.39	46.15	Average	54	Pass
NVNT	n40	5510	-43.77	-43.56	-40.65	5.39	59.96	Peak	68.2	Pass
NVNT	n40	5510	-55.44	-55.92	-52.66	5.39	47.95	Average	54	Pass
NVNT	n40	5510	-43.77	-48.36	-42.47	5.39	58.14	Peak	68.2	Pass
NVNT	n40	5510	-56.07	-55.92	-52.98	5.39	47.63	Average	54	Pass
NVNT	n40	5670	-48.56	-45.09	-43.48	5.39	57.14	Peak	68.2	Pass
NVNT	n40	5670	-57.26	-53.56	-52.02	5.39	48.60	Average	54	Pass
NVNT	n40	5670	-47.78	-43.63	-42.22	5.39	58.40	Peak	68.2	Pass
NVNT	n40	5670	-57.09	-53.5	-51.92	5.39	48.69	Average	54	Pass
NVNT	n40	5670	-49.45	-47	-45.04	5.39	55.57	Peak	68.2	Pass
NVNT	n40	5670	-57.4	-54.97	-53.01	5.39	47.61	Average	54	Pass
NVNT	ac20	5500	-48.89	-49.12	-45.99	5.39	54.62	Peak	68.2	Pass
NVNT	ac20	5500	-57.32	-57.48	-54.39	5.39	46.23	Average	54	Pass
NVNT	ac20	5500	-42.76	-44.34	-40.47	5.39	60.15	Peak	68.2	Pass
NVNT	ac20	5500	-55.68	-55.97	-52.81	5.39	47.81	Average	54	Pass
NVNT	ac20	5500	-46.62	-46.63	-43.61	5.39	57.00	Peak	68.2	Pass
NVNT	ac20	5500	-56.15	-56.39	-53.26	5.39	47.36	Average	54	Pass
NVNT	ac20	5700	-38.94	-42.5	-37.35	5.39	63.26	Peak	68.2	Pass
NVNT	ac20	5700	-53.31	-53.64	-50.46	5.39	50.16	Average	54	Pass
NVNT	ac20	5700	-38.94	-40.59	-36.68	5.39	63.94	Peak	68.2	Pass
NVNT	ac20	5700	-52.63	-53.38	-49.98	5.39	50.64	Average	54	Pass
NVNT	ac20	5700	-49.11	-46.99	-44.91	5.39	55.71	Peak	68.2	Pass
NVNT	ac20	5700	-56.94	-57.11	-54.01	5.39	46.60	Average	54	Pass
NVNT	ac40	5510	-48.81	-47.77	-45.25	5.39	55.37	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5510	-57.39	-57.65	-54.51	5.39	46.11	Average	54	Pass
NVNT	ac40	5510	-45.29	-42.06	-40.37	5.39	60.25	Peak	68.2	Pass
NVNT	ac40	5510	-55.41	-55.75	-52.57	5.39	48.05	Average	54	Pass
NVNT	ac40	5510	-45.75	-48.17	-43.78	5.39	56.83	Peak	68.2	Pass
NVNT	ac40	5510	-55.94	-56.22	-53.07	5.39	47.55	Average	54	Pass
NVNT	ac40	5670	-48.36	-49.4	-45.84	5.39	54.78	Peak	68.2	Pass
NVNT	ac40	5670	-57.19	-57.45	-54.31	5.39	46.31	Average	54	Pass
NVNT	ac40	5670	-47.43	-47.16	-44.28	5.39	56.33	Peak	68.2	Pass
NVNT	ac40	5670	-56.77	-57.06	-53.90	5.39	46.72	Average	54	Pass
NVNT	ac40	5670	-48.81	-49.29	-46.03	5.39	54.58	Peak	68.2	Pass
NVNT	ac40	5670	-57.32	-57.59	-54.44	5.39	46.17	Average	54	Pass
NVNT	ac80	5530	-48.83	-48.52	-45.66	5.39	54.96	Peak	68.2	Pass
NVNT	ac80	5530	-56.98	-56.89	-53.92	5.39	46.69	Average	54	Pass
NVNT	ac80	5530	-41.68	-44.36	-39.81	5.39	60.81	Peak	68.2	Pass
NVNT	ac80	5530	-55	-55.21	-52.09	5.39	48.52	Average	54	Pass
NVNT	ac80	5530	-45.89	-44.93	-42.37	5.39	58.24	Peak	68.2	Pass
NVNT	ac80	5530	-55.56	-55.21	-52.37	5.39	48.25	Average	54	Pass
NVNT	ac80	5610	-49.31	-49.95	-46.61	5.39	54.01	Peak	68.2	Pass
NVNT	ac80	5610	-57.92	-58.08	-54.99	5.39	45.63	Average	54	Pass
NVNT	ac80	5610	-47.82	-46.75	-44.24	5.39	56.38	Peak	68.2	Pass
NVNT	ac80	5610	-56.88	-57.04	-53.95	5.39	46.67	Average	54	Pass
NVNT	ac80	5610	-49.61	-48.74	-46.14	5.39	54.47	Peak	68.2	Pass
NVNT	ac80	5610	-58.14	-57.64	-54.87	5.39	45.75	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



F.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
NVNT	a	5580	Ant1	5579.98	-20000	-3.58	25	Pass
NVNT	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
NVNT	n20	5500	Ant1	5500	0	0	25	Pass
NVNT	n20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
NVNT	n20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
NVNT	n40	5510	Ant1	5510	0	0	25	Pass
NVNT	n40	5550	Ant1	5550	0	0	25	Pass
NVNT	n40	5670	Ant1	5670	0	0	25	Pass
NVNT	ac20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
NVNT	ac20	5580	Ant1	5580	0	0	25	Pass
NVNT	ac20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
NVNT	ac40	5510	Ant1	5509.96	-40000	-7.26	25	Pass
NVNT	ac40	5550	Ant1	5550	0	0	25	Pass
NVNT	ac40	5670	Ant1	5670	0	0	25	Pass
NVNT	ac80	5530	Ant1	5530	0	0	25	Pass
NVNT	ac80	5610	Ant1	5610	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5500MHz Ant1

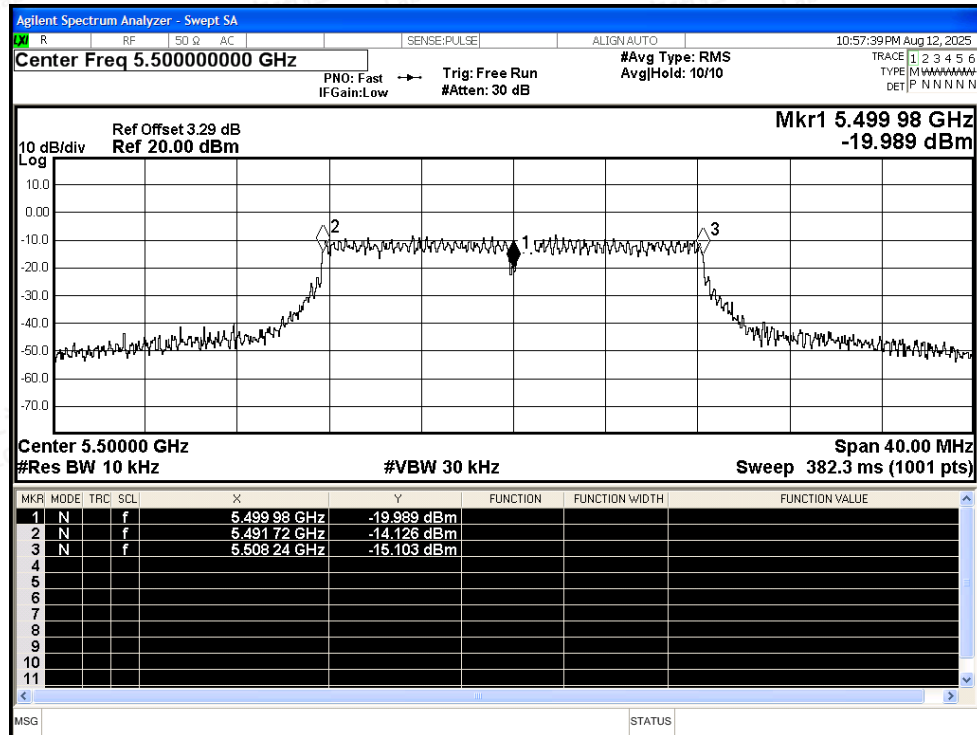

Freq. Stability NVNT a 5580MHz Ant1

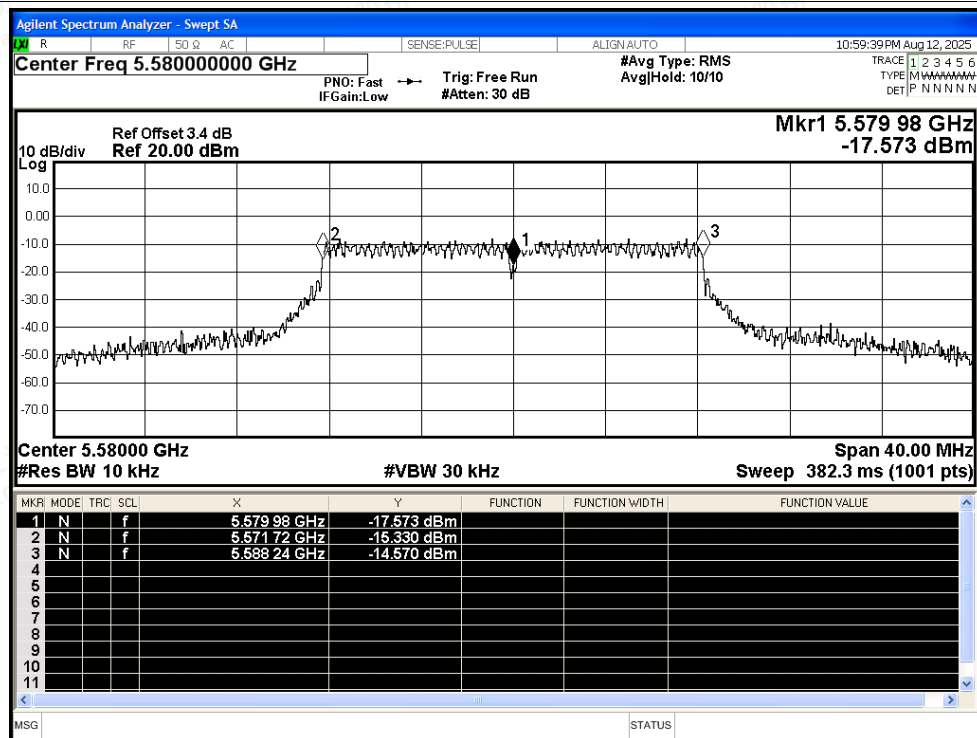

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5700MHz Ant1

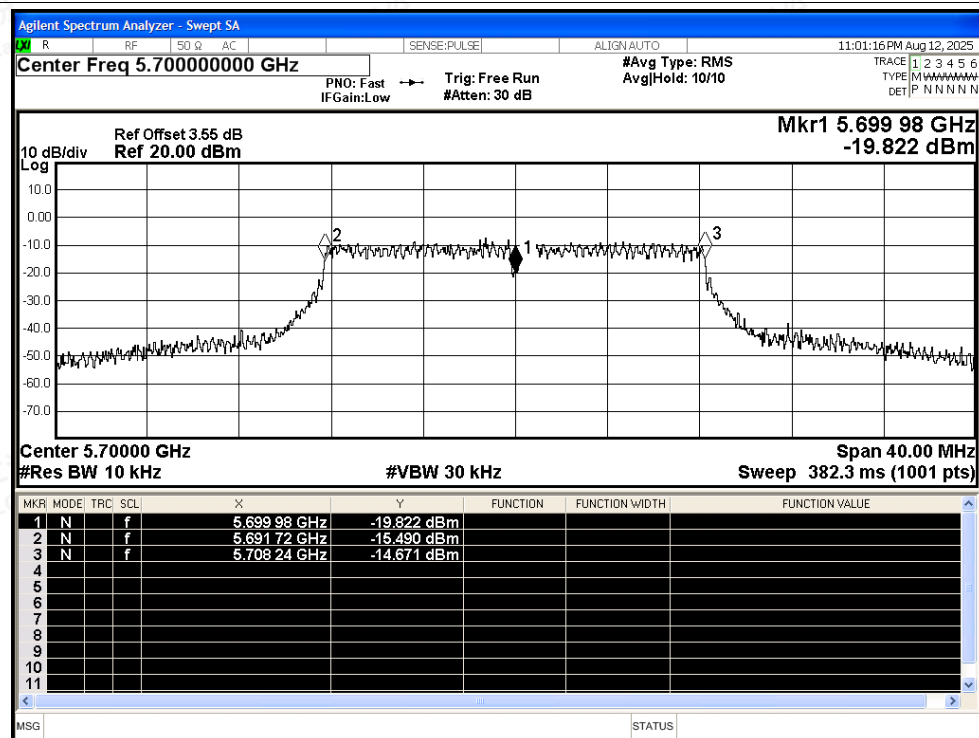

Freq. Stability NVNT n20 5500MHz Ant1

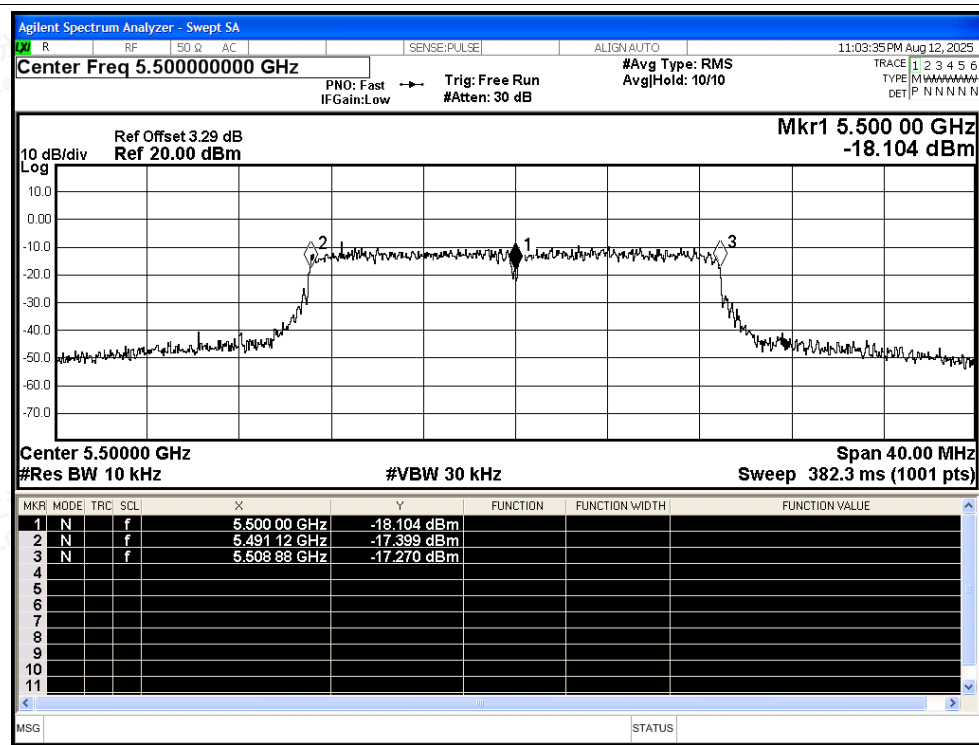

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5580MHz Ant1

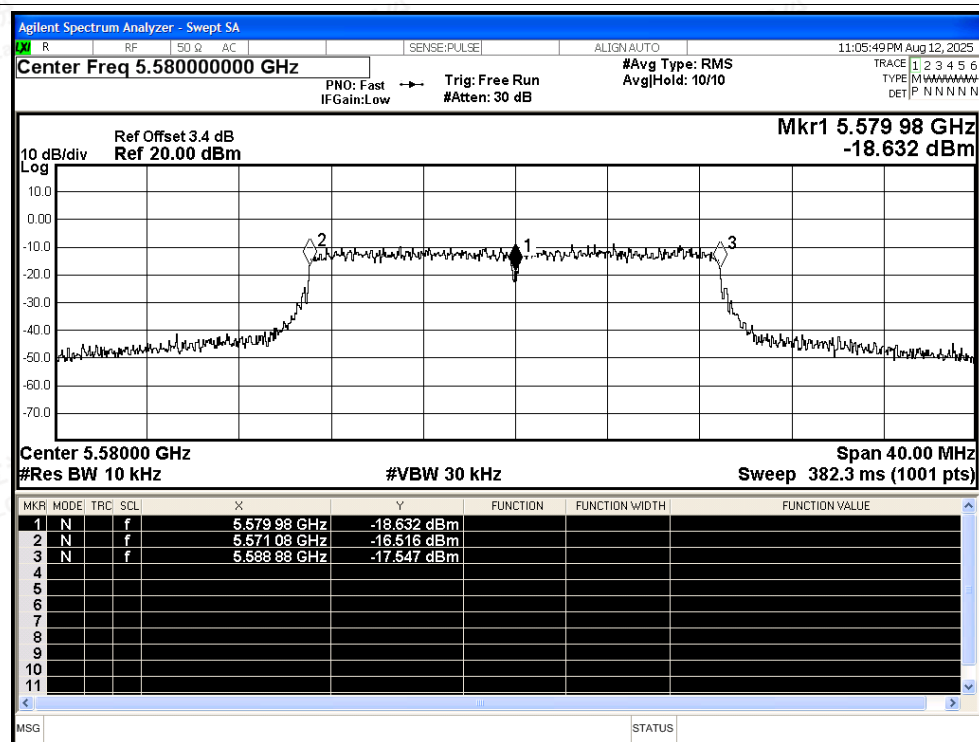

Freq. Stability NVNT n20 5700MHz Ant1

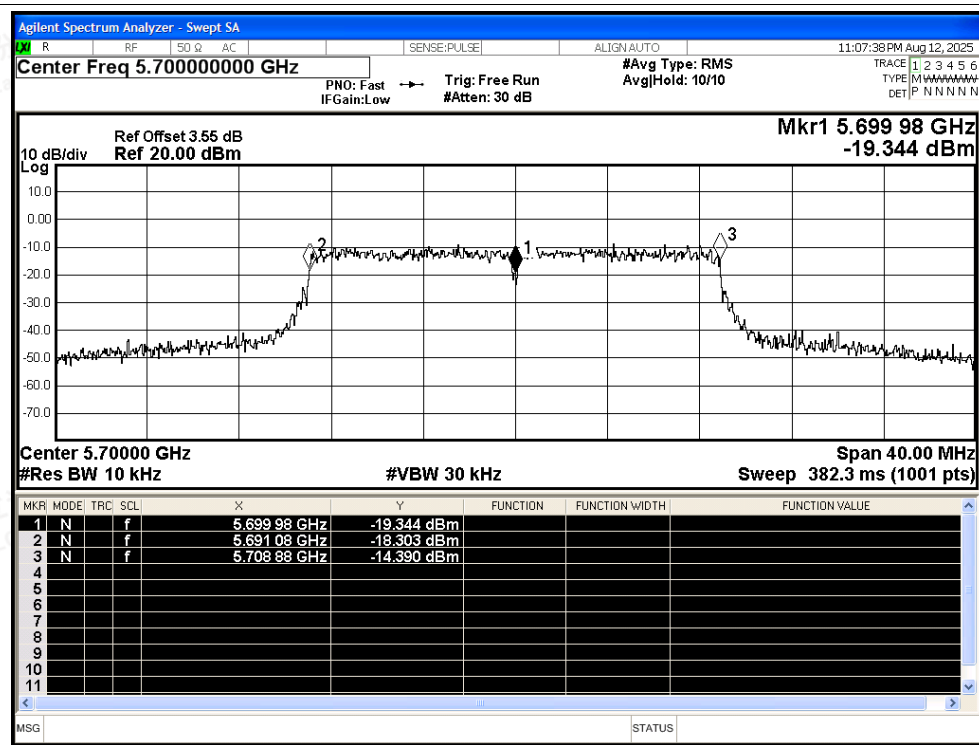

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5510MHz Ant1

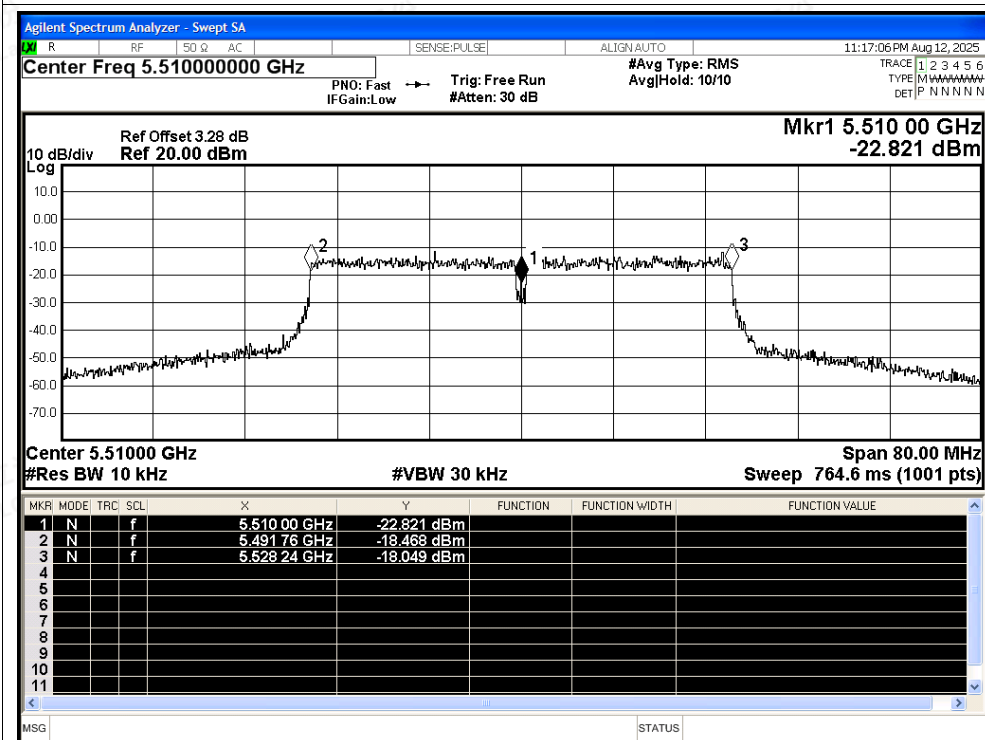

Freq. Stability NVNT n40 5550MHz Ant1

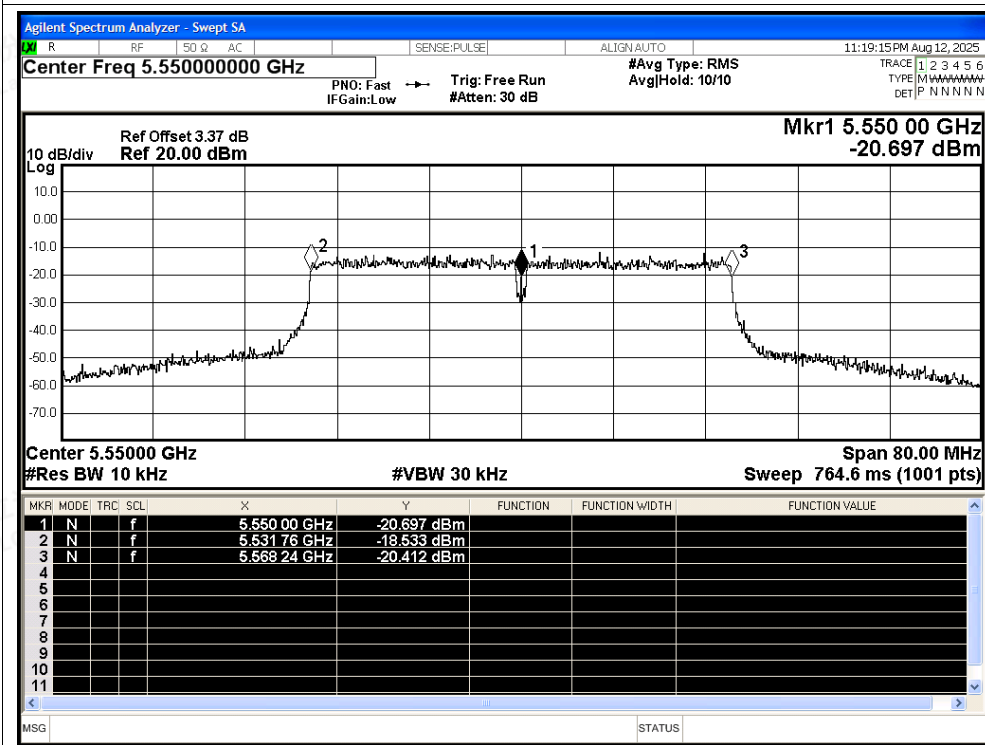

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5670MHz Ant1

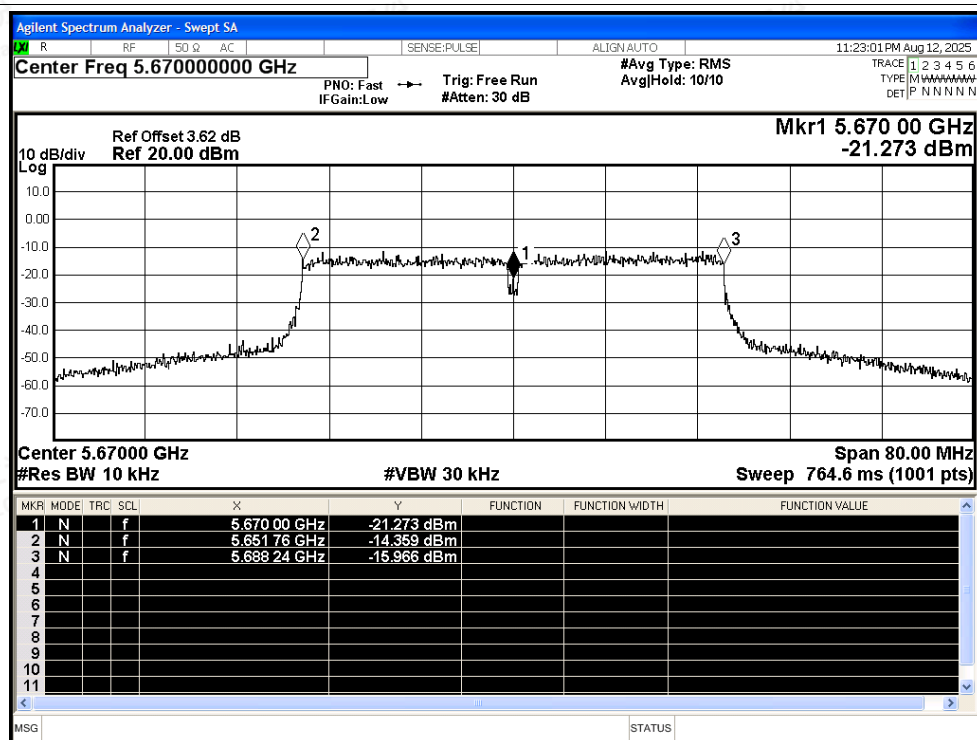

Freq. Stability NVNT ac20 5500MHz Ant1

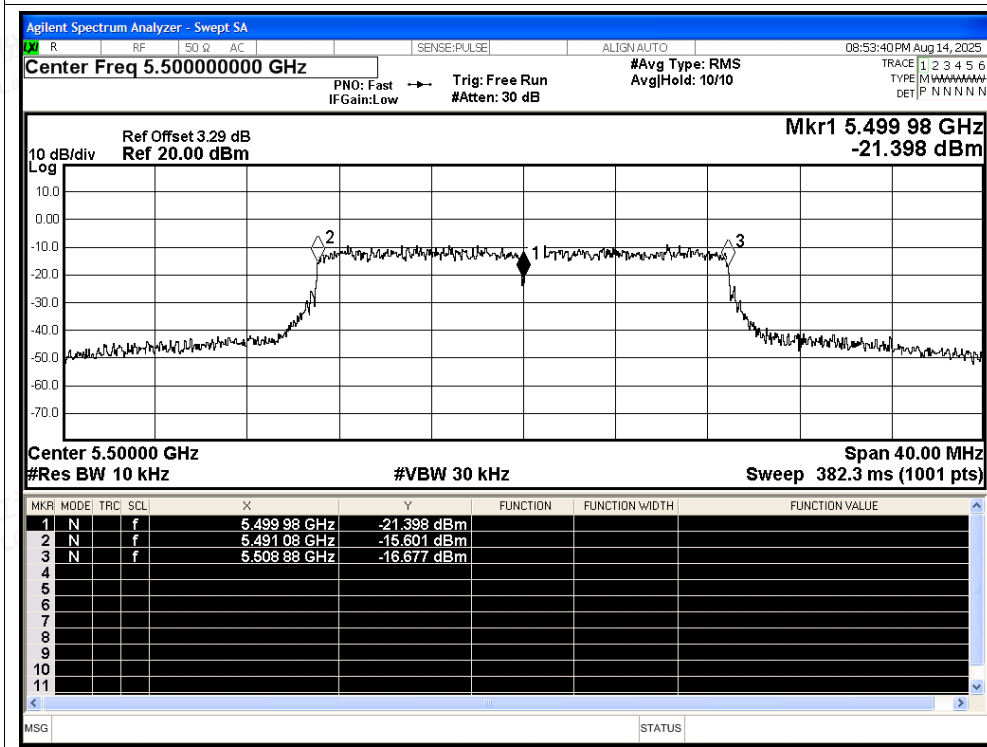

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5580MHz Ant1

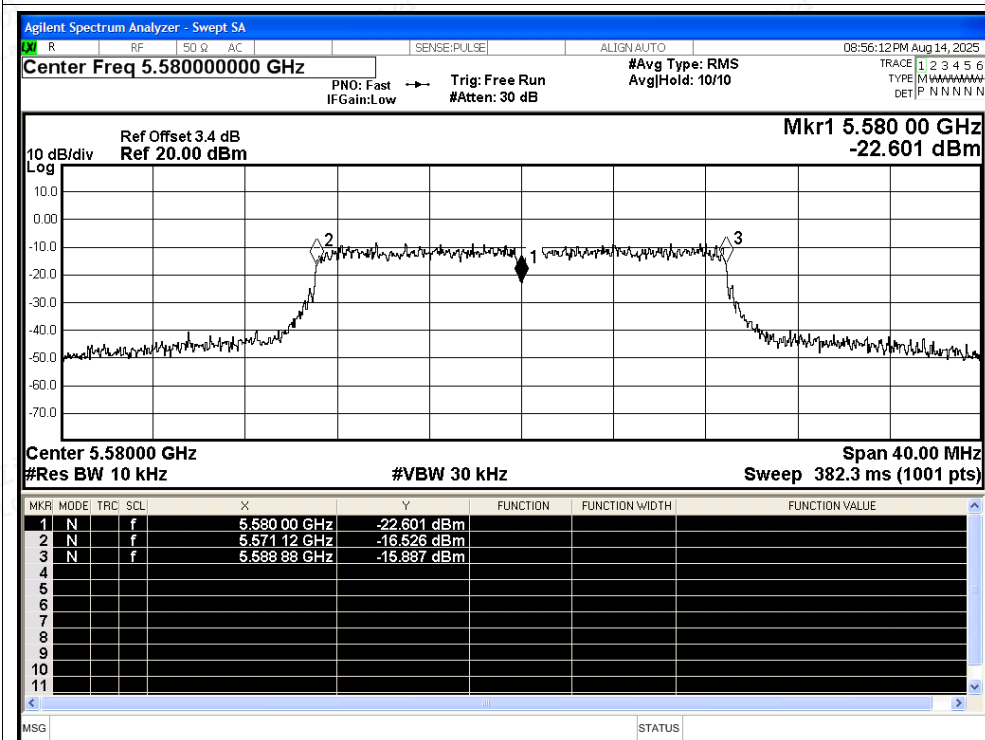

Freq. Stability NVNT ac20 5700MHz Ant1

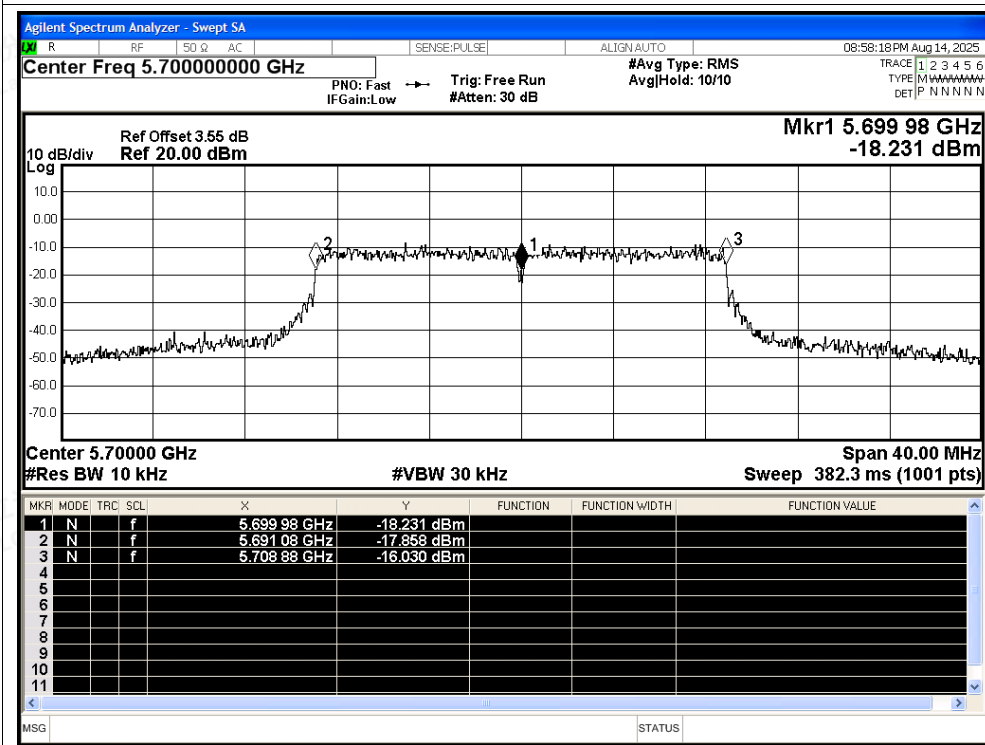

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5510MHz Ant1

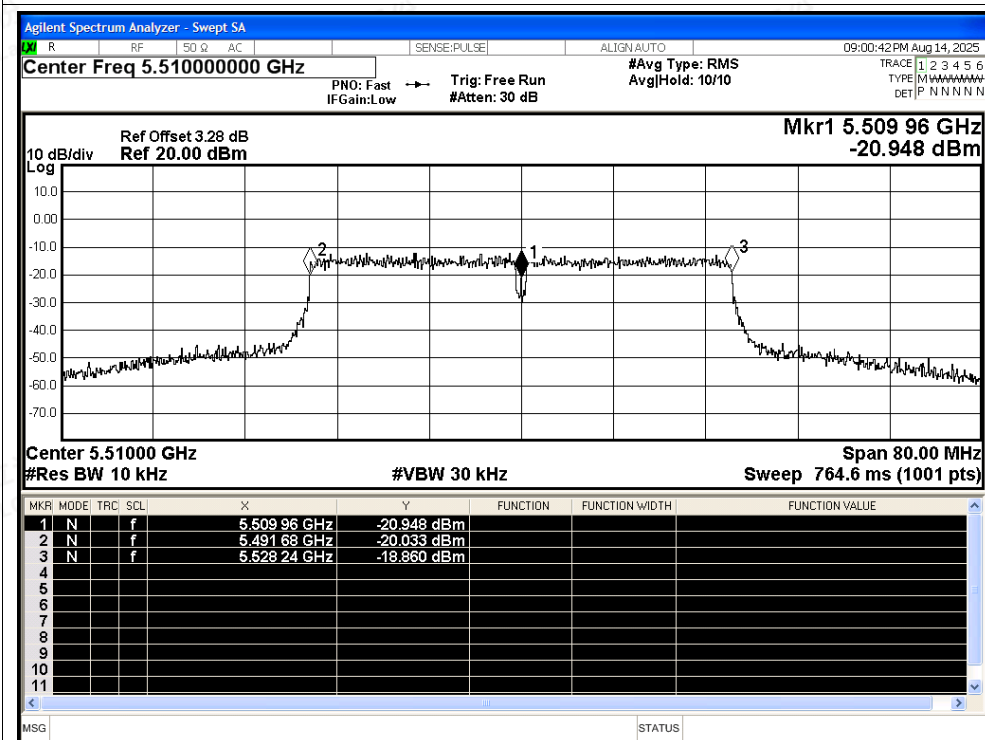

Freq. Stability NVNT ac40 5550MHz Ant1

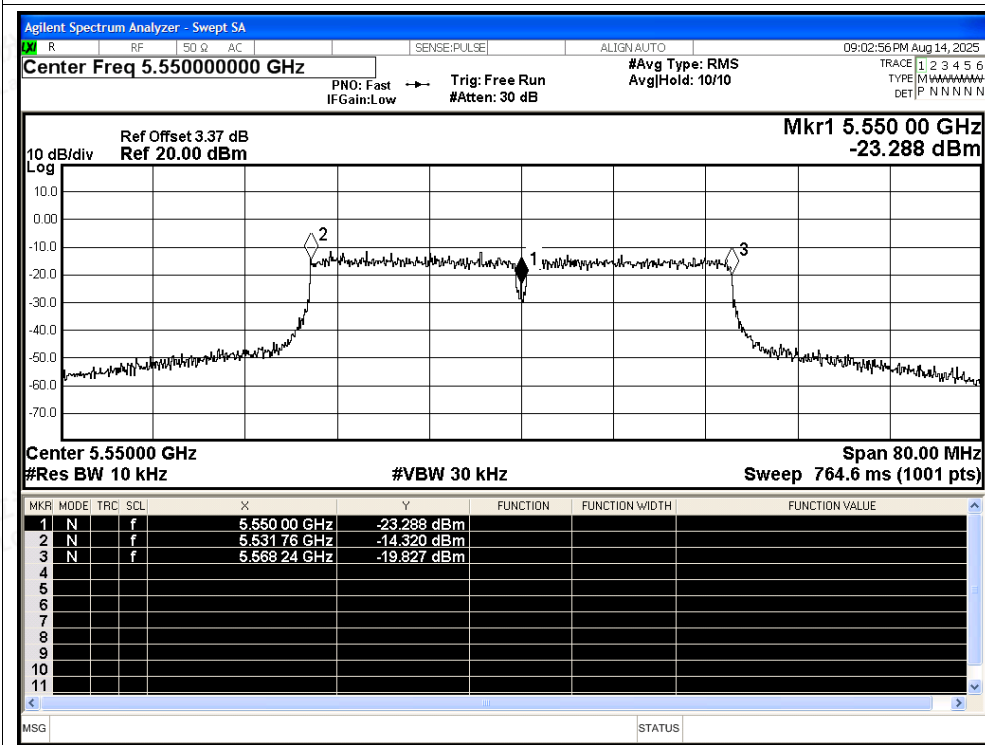

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5670MHz Ant1

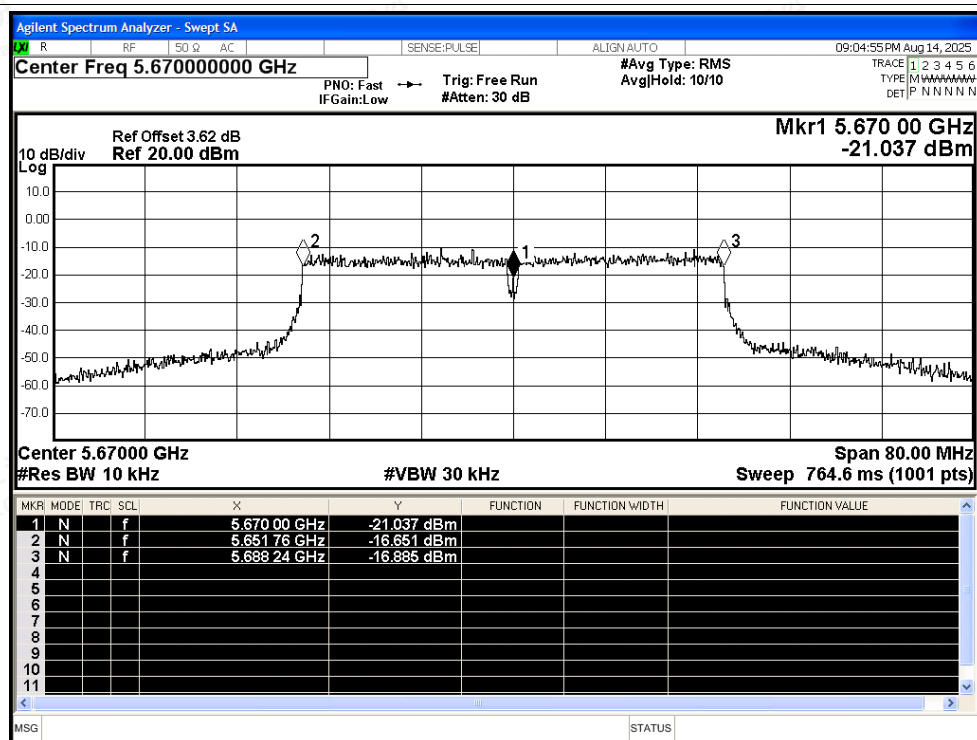

Freq. Stability NVNT ac80 5530MHz Ant1

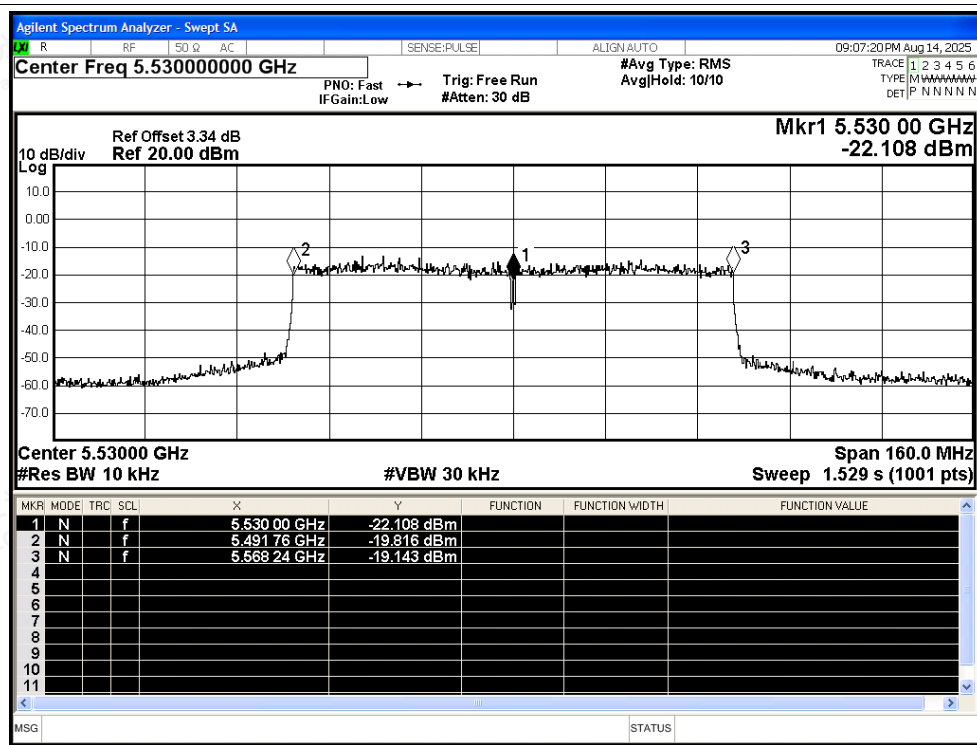


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

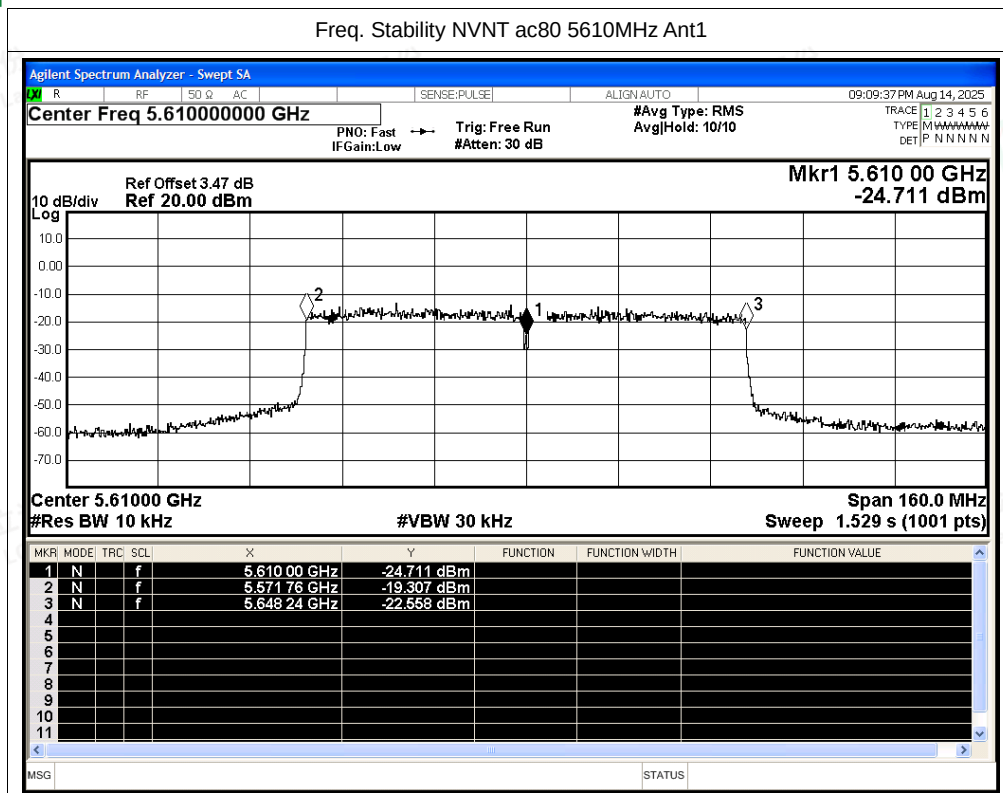

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5500	Ant2	5500	0	0	25	Pass
NVNT	a	5580	Ant2	5579.98	-20000	-3.58	25	Pass
NVNT	a	5700	Ant2	5699.98	-20000	-3.51	25	Pass
NVNT	n20	5500	Ant2	5499.98	-20000	-3.64	25	Pass
NVNT	n20	5580	Ant2	5579.98	-20000	-3.58	25	Pass
NVNT	n20	5700	Ant2	5699.98	-20000	-3.51	25	Pass
NVNT	n40	5510	Ant2	5509.96	-40000	-7.26	25	Pass
NVNT	n40	5550	Ant2	5550	0	0	25	Pass
NVNT	n40	5670	Ant2	5670	0	0	25	Pass
NVNT	ac20	5500	Ant2	5499.98	-20000	-3.64	25	Pass
NVNT	ac20	5580	Ant2	5579.98	-20000	-3.58	25	Pass
NVNT	ac20	5700	Ant2	5700	0	0	25	Pass
NVNT	ac40	5510	Ant2	5509.96	-40000	-7.26	25	Pass
NVNT	ac40	5550	Ant2	5549.96	-40000	-7.21	25	Pass
NVNT	ac40	5670	Ant2	5670	0	0	25	Pass
NVNT	ac80	5530	Ant2	5530	0	0	25	Pass
NVNT	ac80	5610	Ant2	5610	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5500MHz Ant2

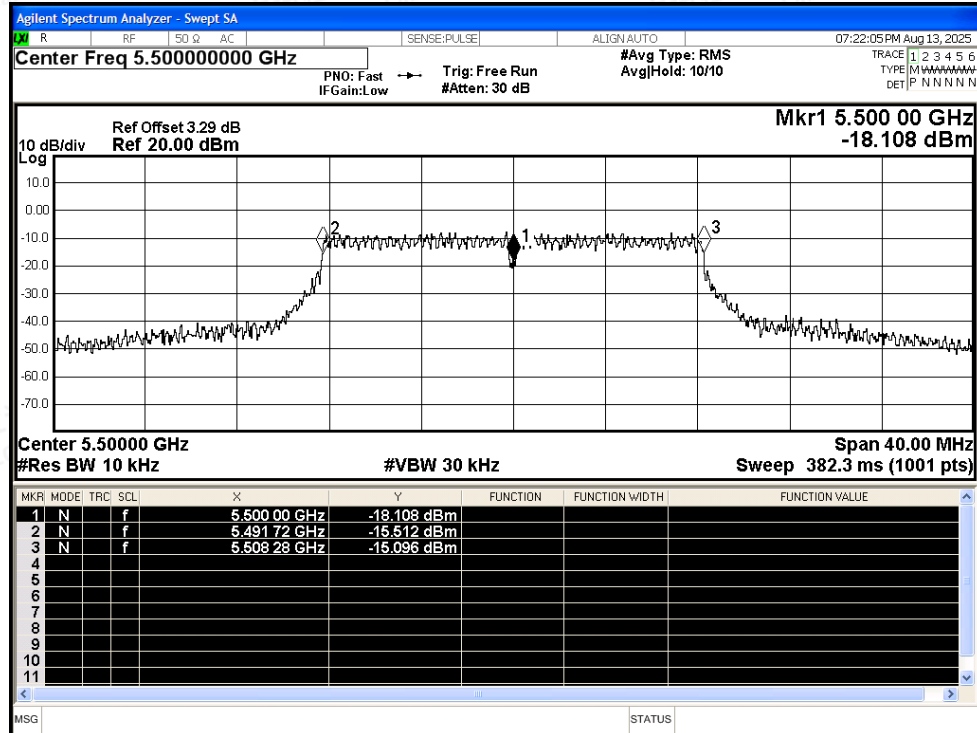

Freq. Stability NVNT a 5580MHz Ant2

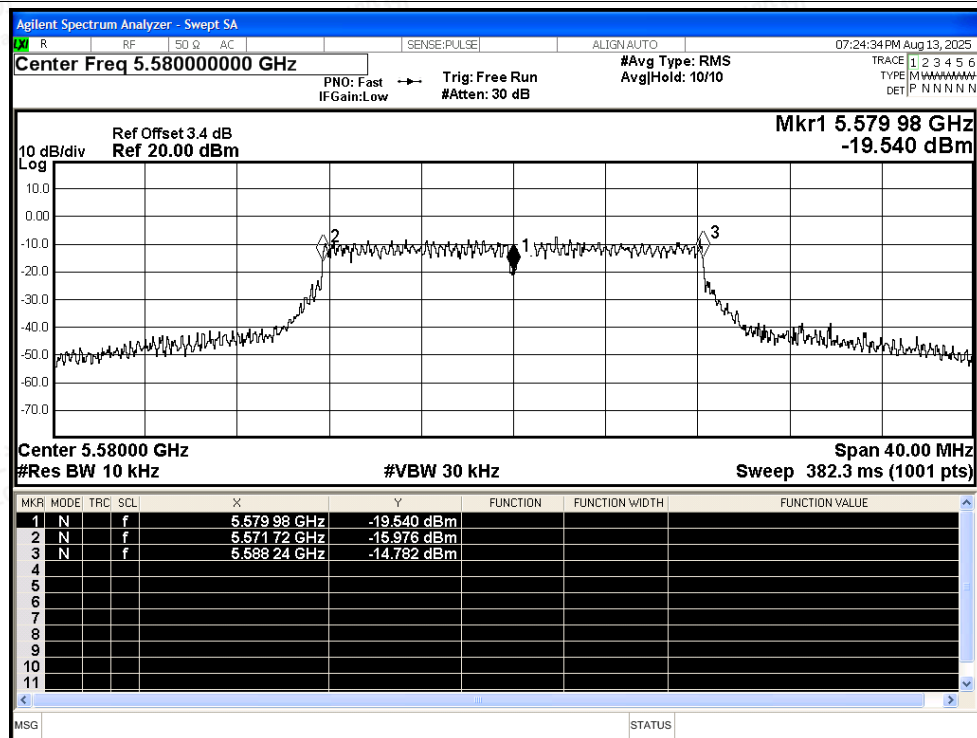

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5700MHz Ant2

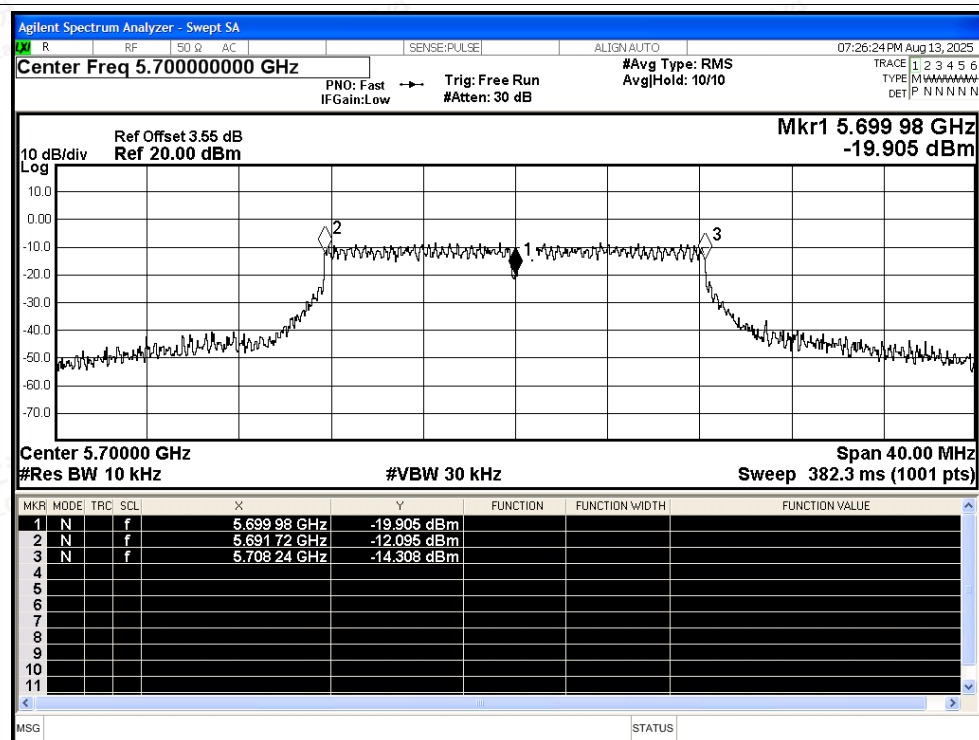

Freq. Stability NVNT n20 5500MHz Ant2

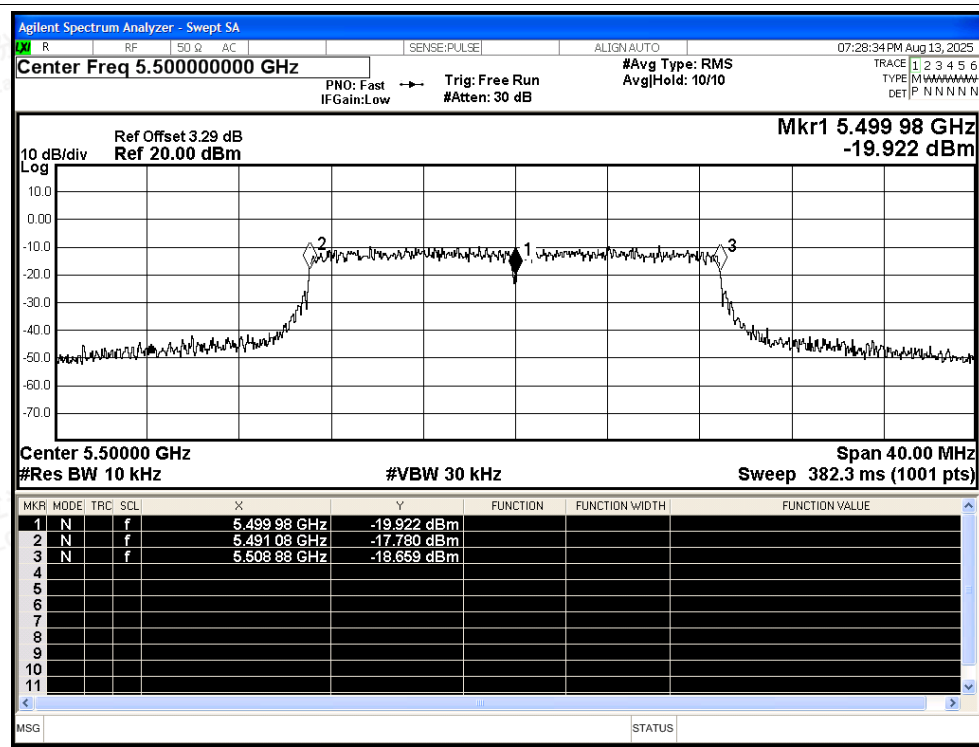

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5580MHz Ant2

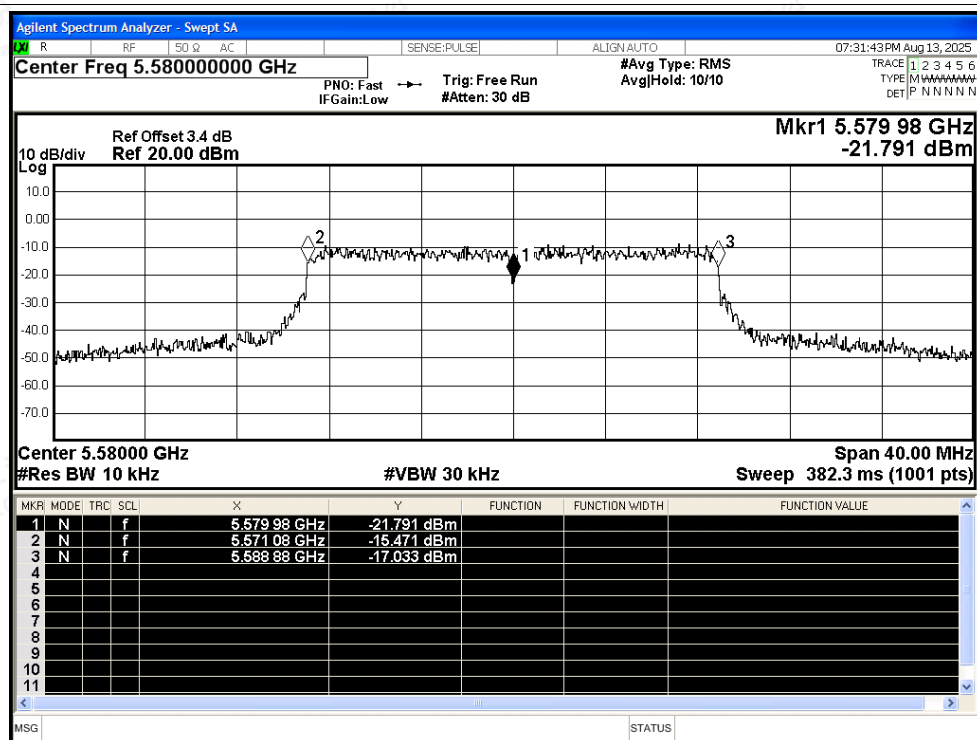

Freq. Stability NVNT n20 5700MHz Ant2

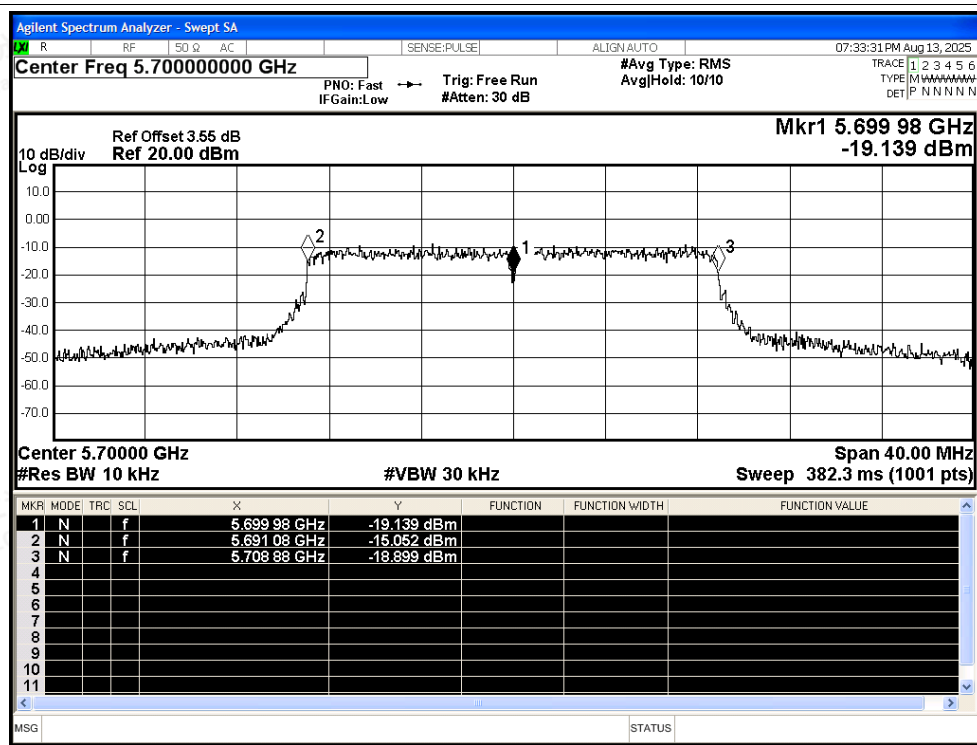

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5510MHz Ant2

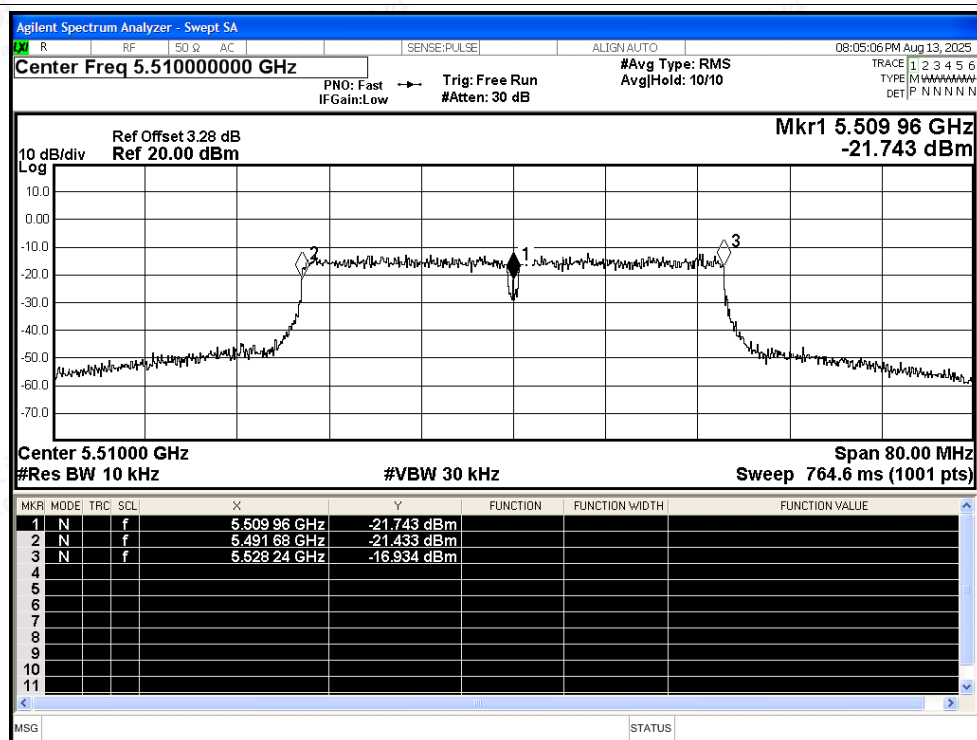

Freq. Stability NVNT n40 5550MHz Ant2

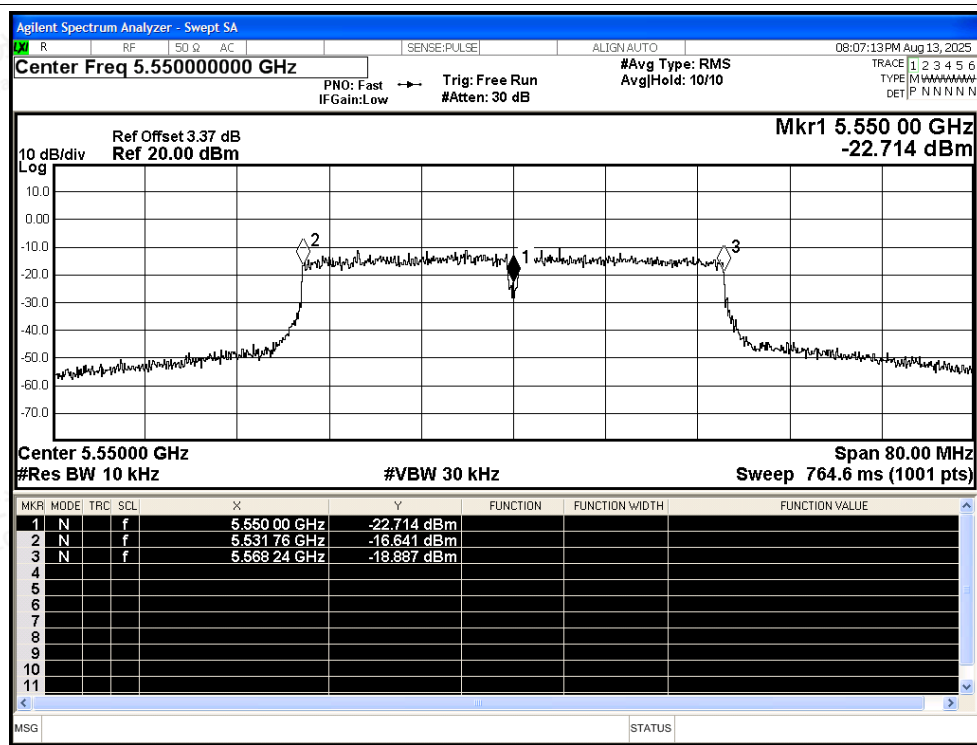

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5670MHz Ant2

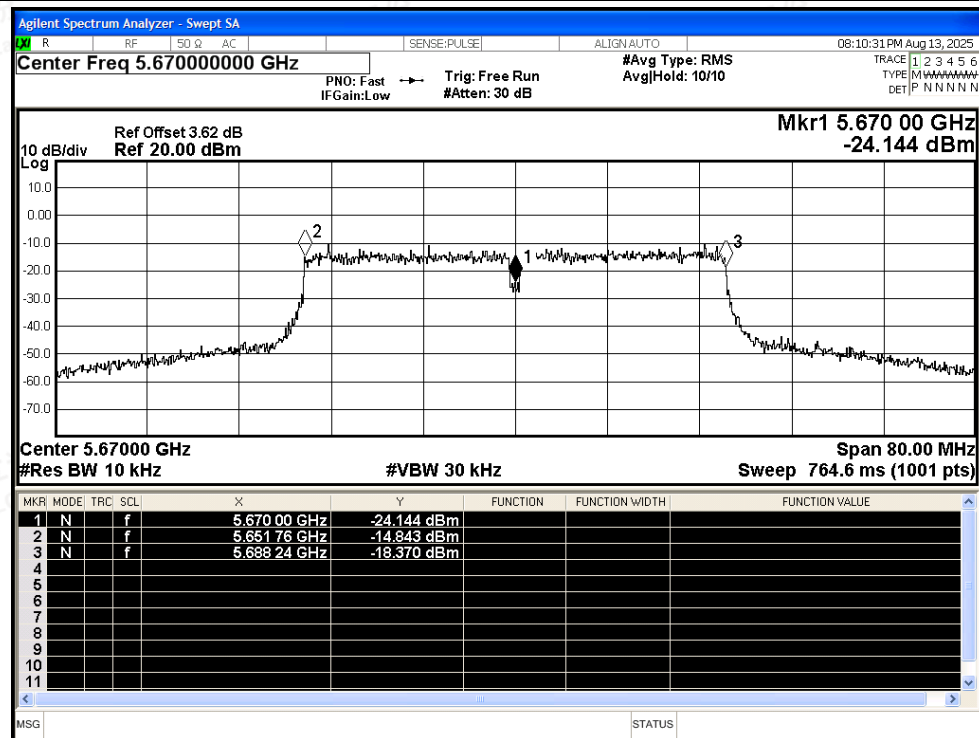

Freq. Stability NVNT ac20 5500MHz Ant2

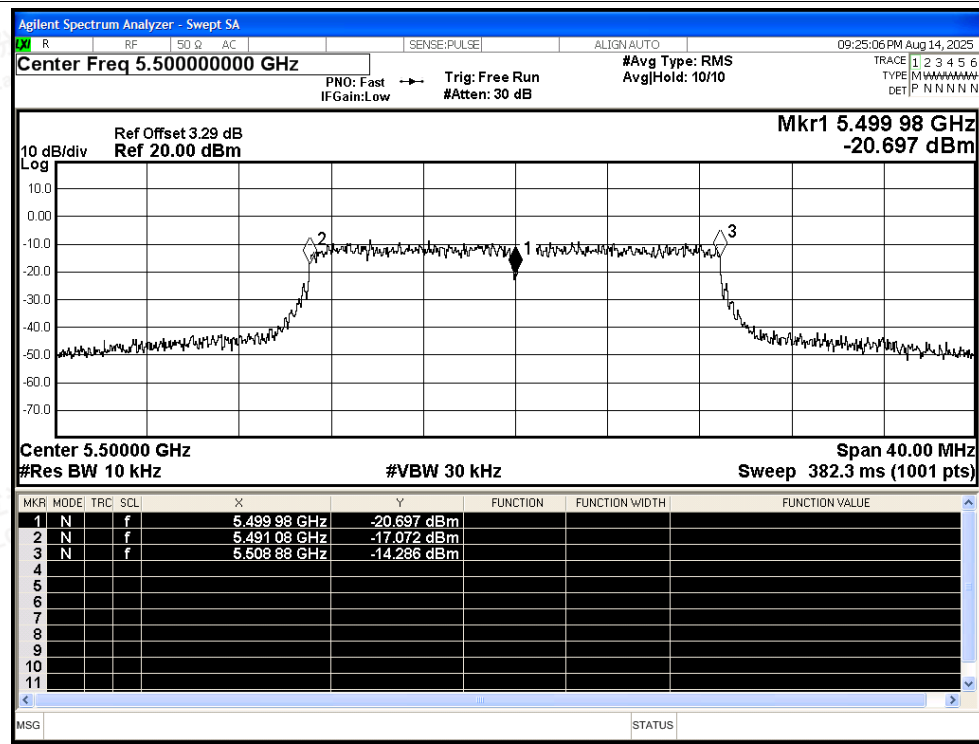

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5580MHz Ant2

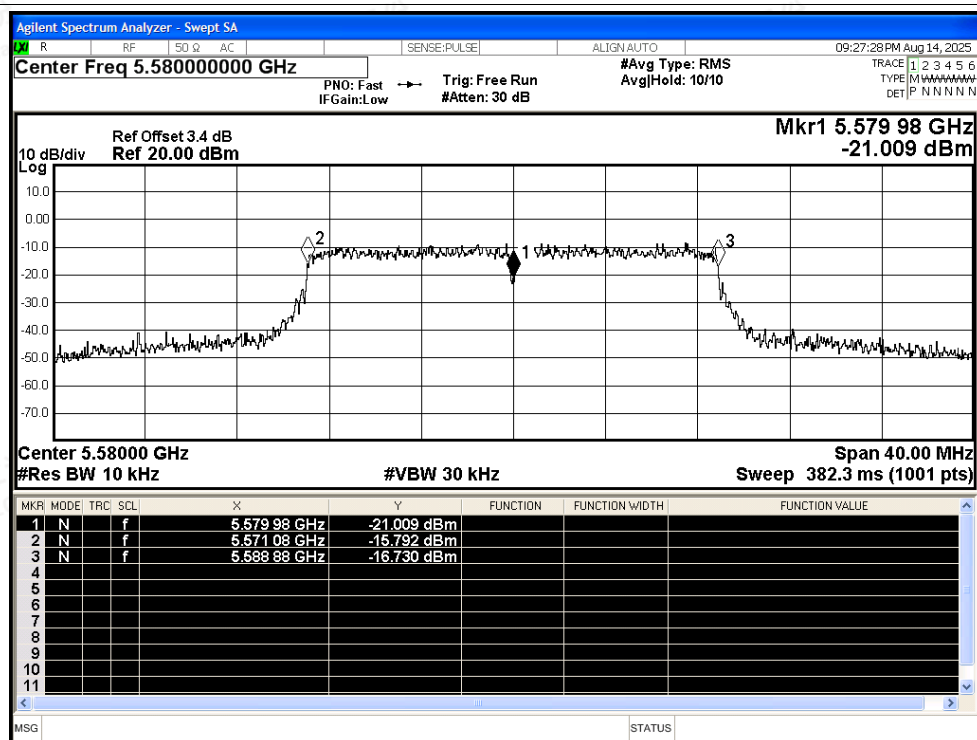

Freq. Stability NVNT ac20 5700MHz Ant2

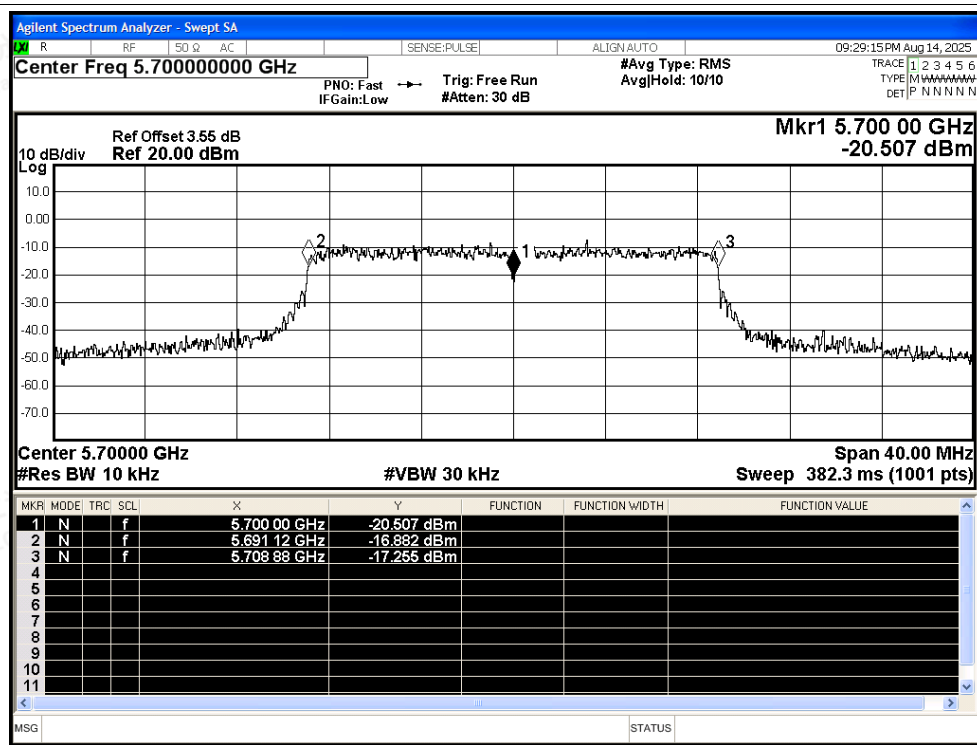

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5510MHz Ant2

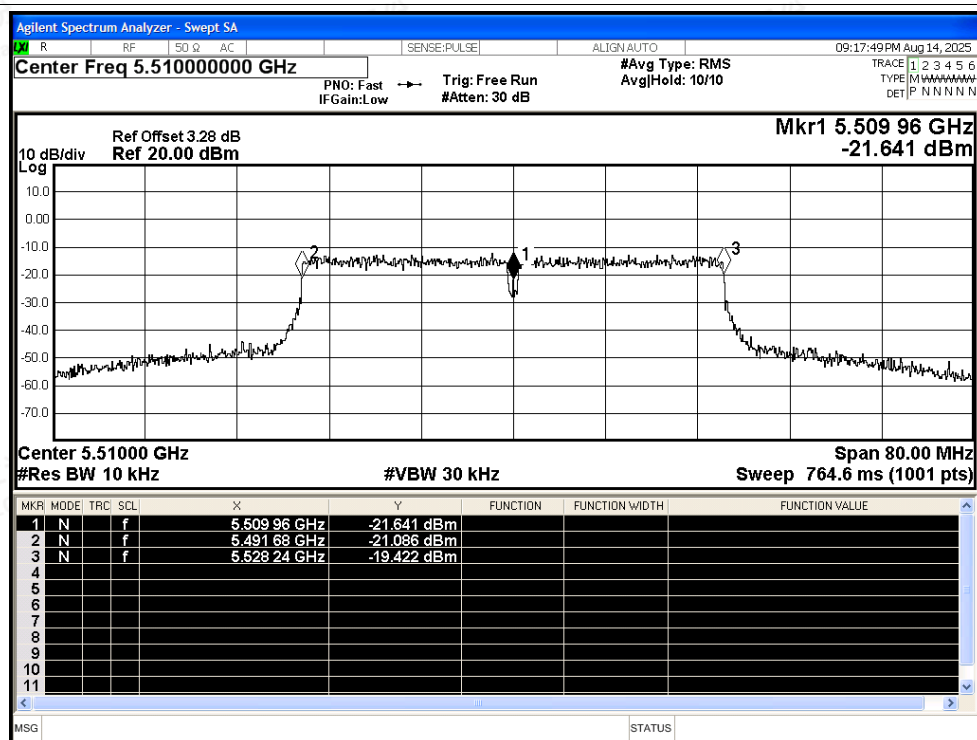

Freq. Stability NVNT ac40 5550MHz Ant2

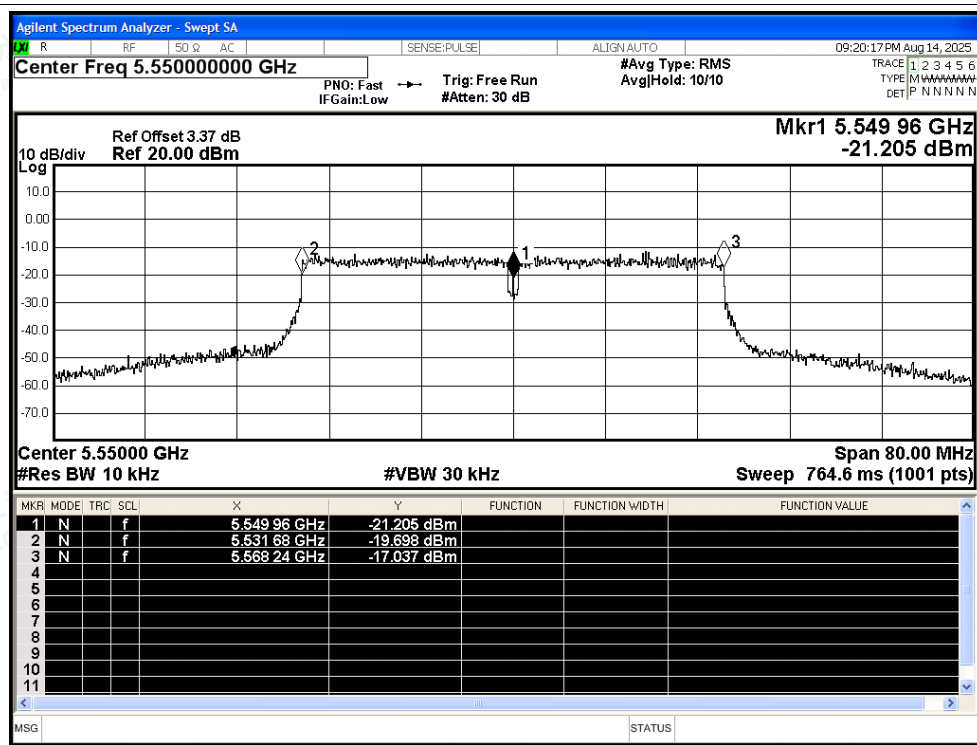

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5670MHz Ant2

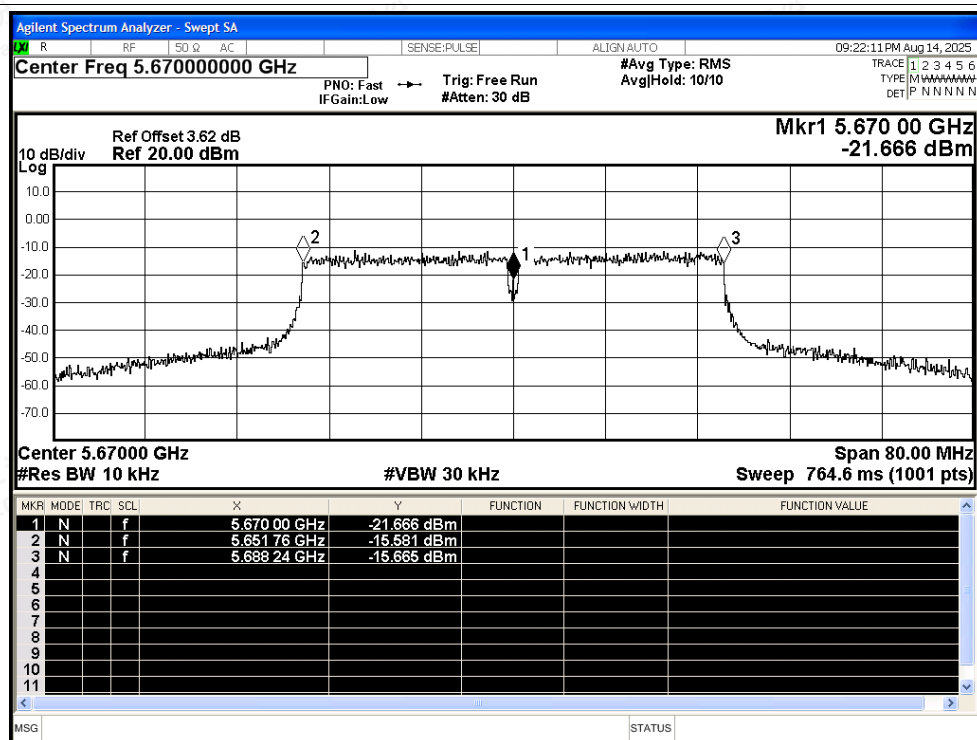

Freq. Stability NVNT ac80 5530MHz Ant2

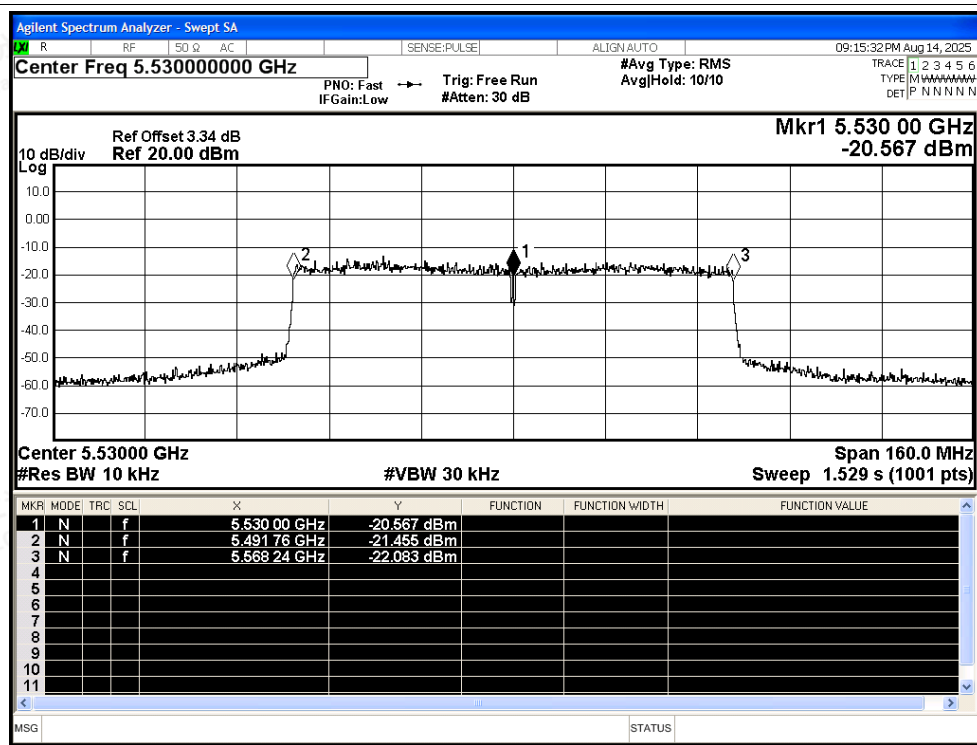

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Freq. Stability NVNT ac80 5610MHz Ant2

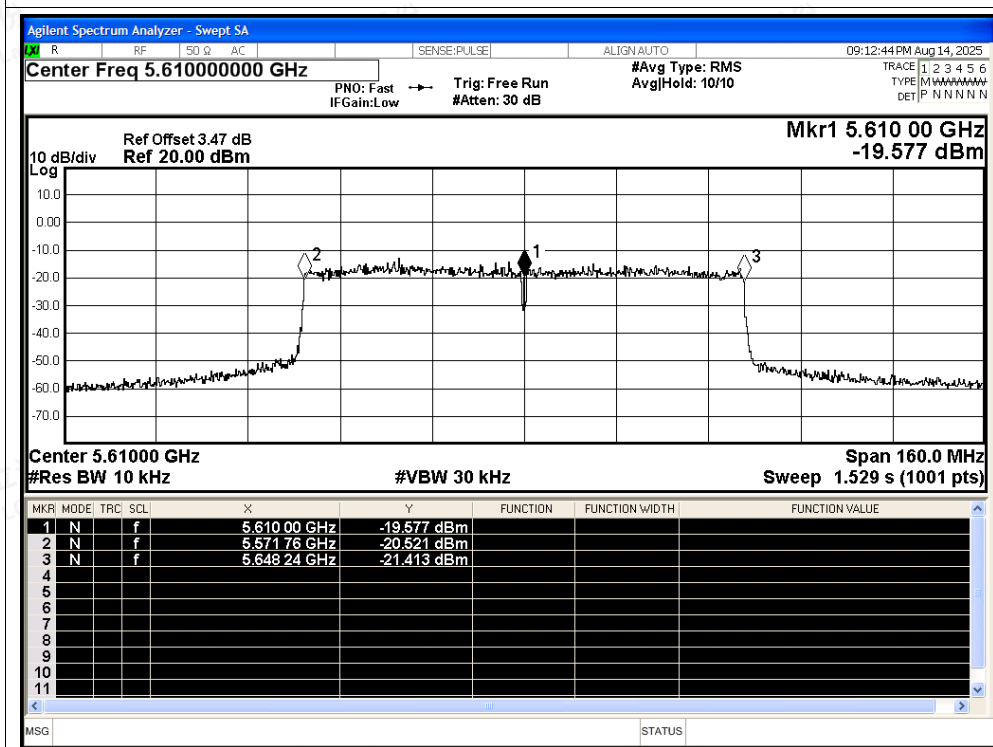

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



F.6 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5500	Ant1	94.56	0.24	0.91
NVNT	a	5580	Ant1	94.56	0.24	0.91
NVNT	a	5700	Ant1	94.65	0.24	0.91
NVNT	n20	5500	Ant1	97.33	0.12	0.44
NVNT	n20	5580	Ant1	97.29	0.12	0.44
NVNT	n20	5700	Ant1	97.29	0.12	0.44
NVNT	n40	5510	Ant1	94.79	0.23	0.9
NVNT	n40	5550	Ant1	94.71	0.24	0.9
NVNT	n40	5670	Ant1	94.71	0.24	0.9
NVNT	ac20	5500	Ant1	97.3	0.12	0.44
NVNT	ac20	5580	Ant1	97.34	0.12	0.44
NVNT	ac20	5700	Ant1	97.34	0.12	0.44
NVNT	ac40	5510	Ant1	94.72	0.24	0.9
NVNT	ac40	5550	Ant1	94.72	0.24	0.9
NVNT	ac40	5670	Ant1	94.72	0.24	0.9
NVNT	ac80	5530	Ant1	89.65	0.47	1.86
NVNT	ac80	5610	Ant1	89.65	0.47	1.86






Test Graphs

Duty Cycle NVNT a 5500MHz Ant1

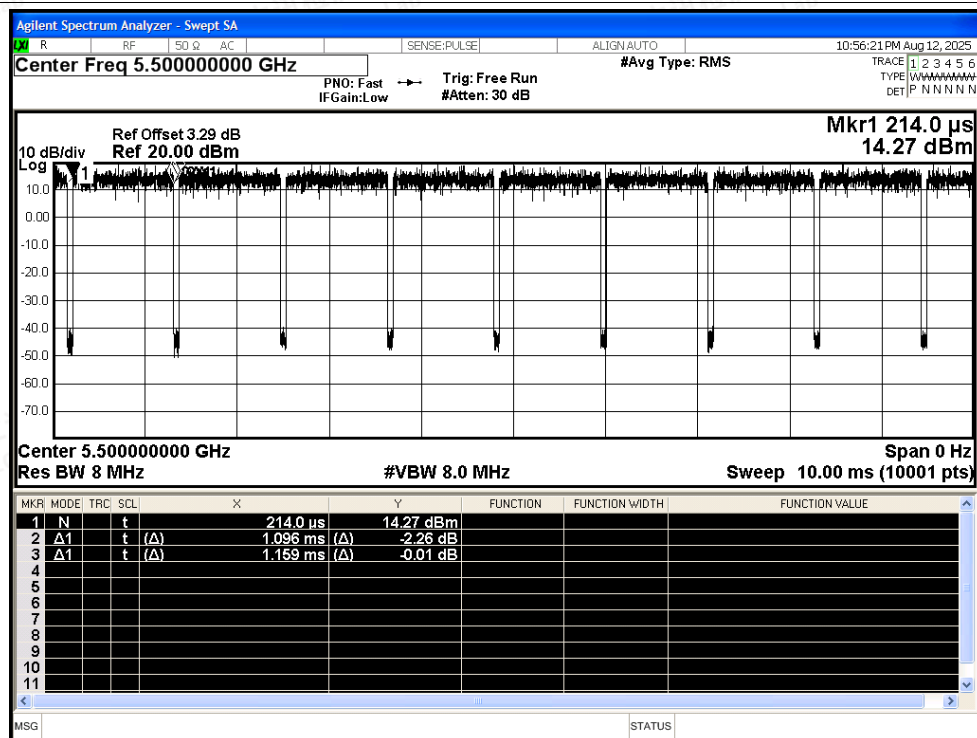

Duty Cycle NVNT a 5580MHz Ant1

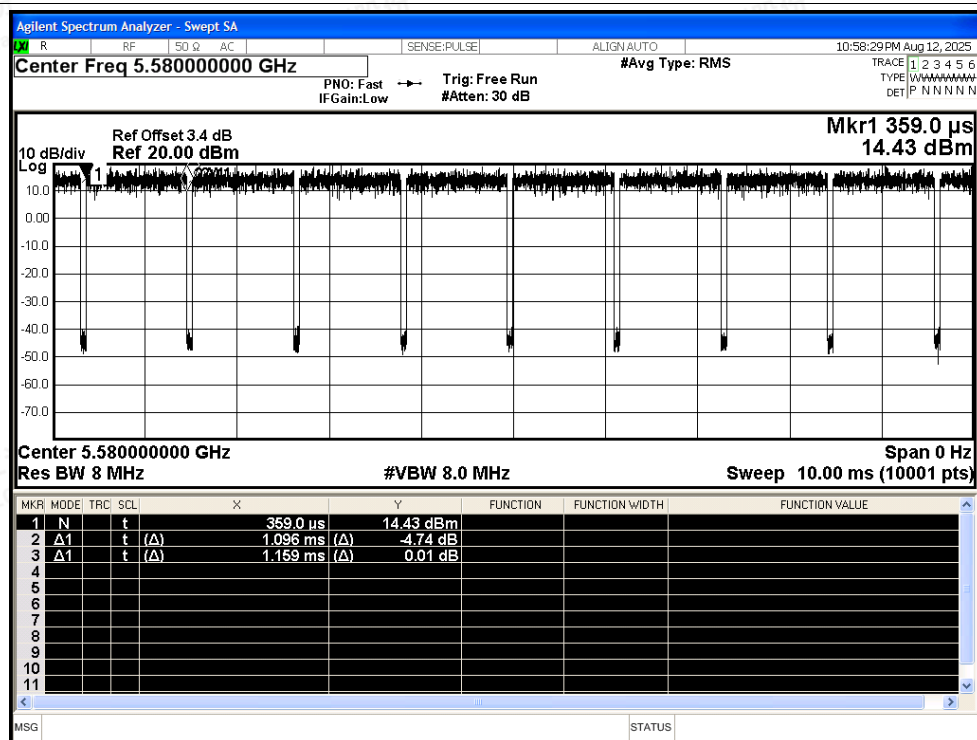

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5700MHz Ant1

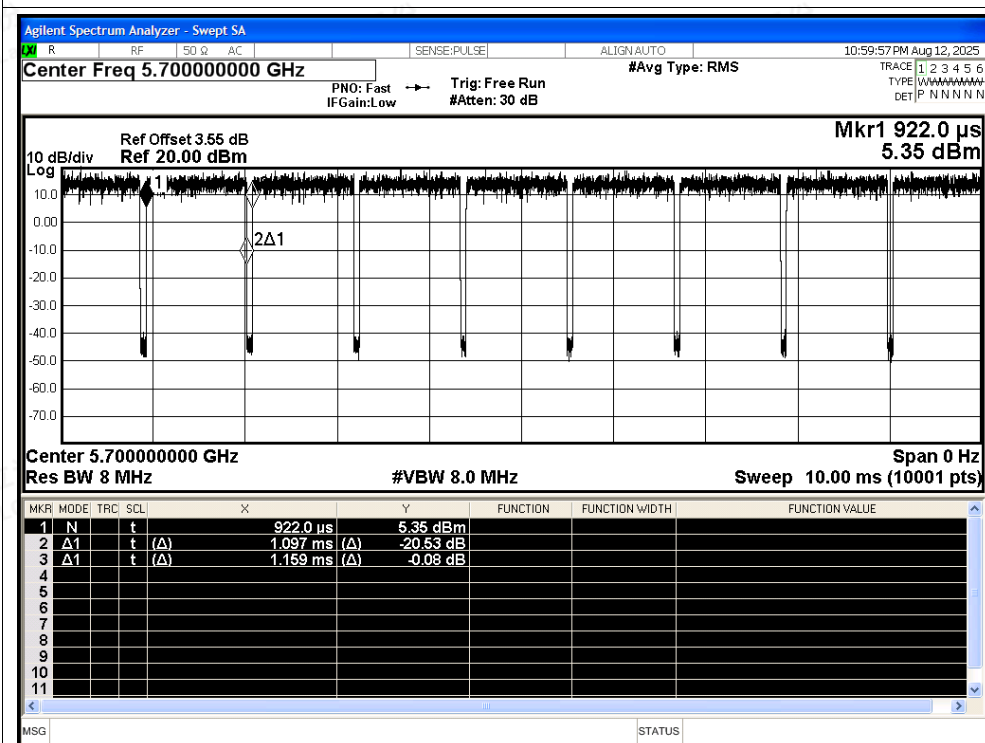

Duty Cycle NVNT n20 5500MHz Ant1

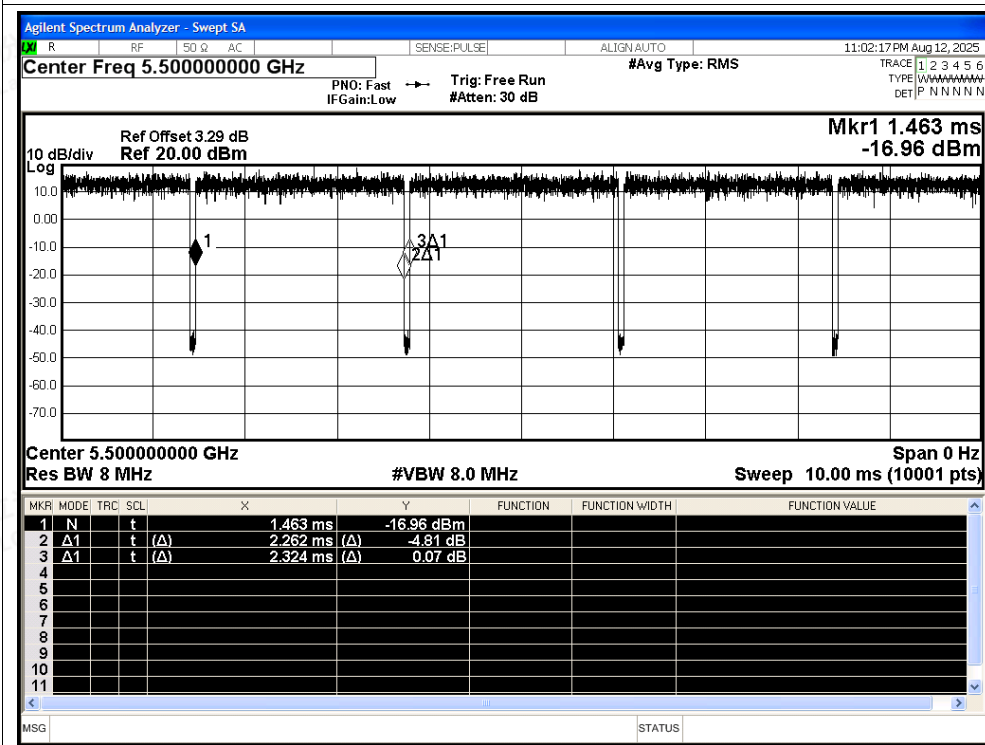

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5580MHz Ant1

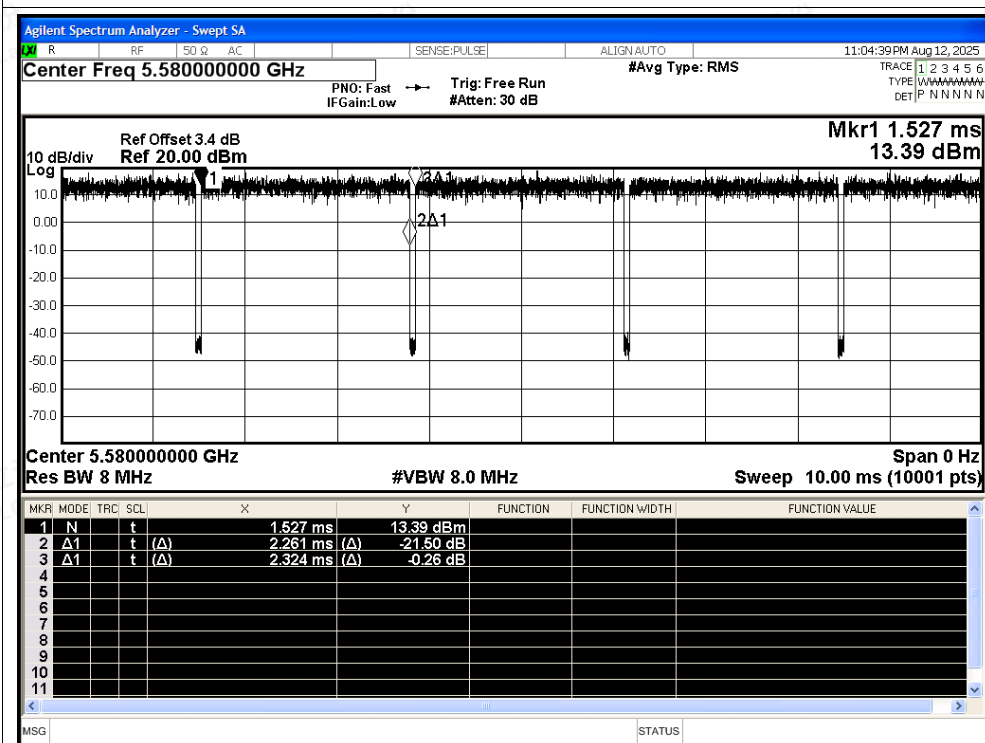

Duty Cycle NVNT n20 5700MHz Ant1

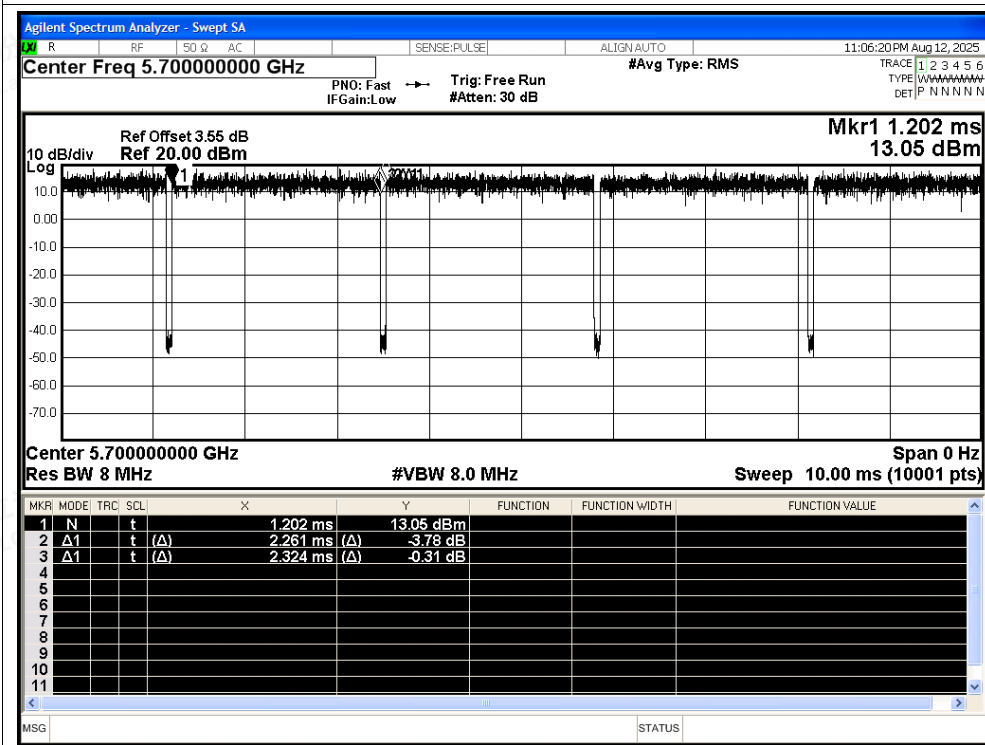

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5510MHz Ant1

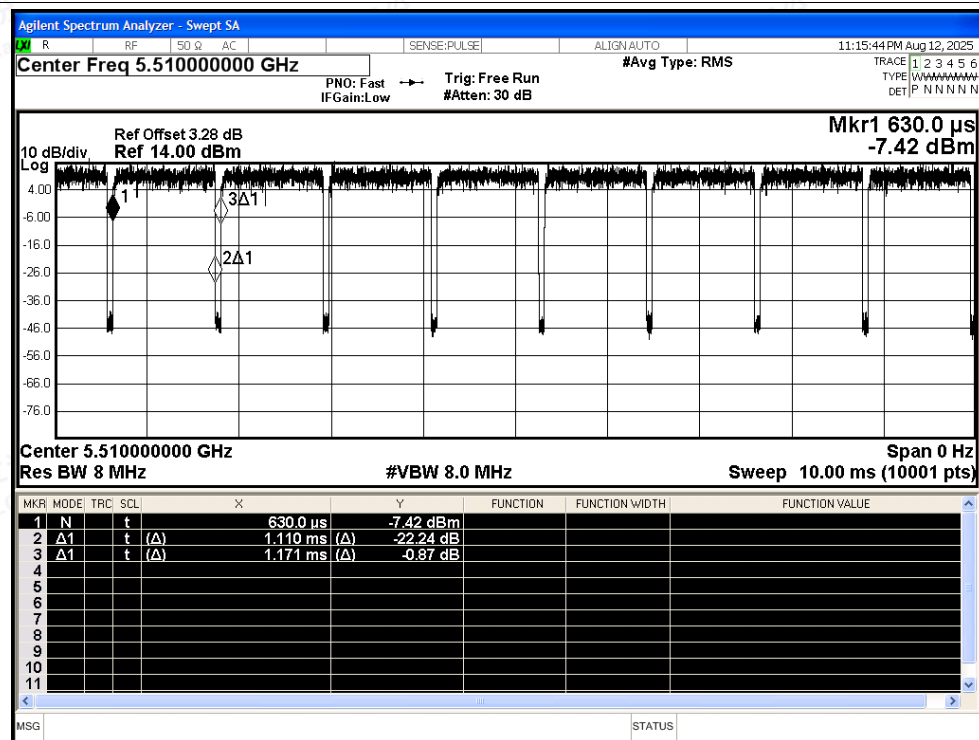

Duty Cycle NVNT n40 5550MHz Ant1

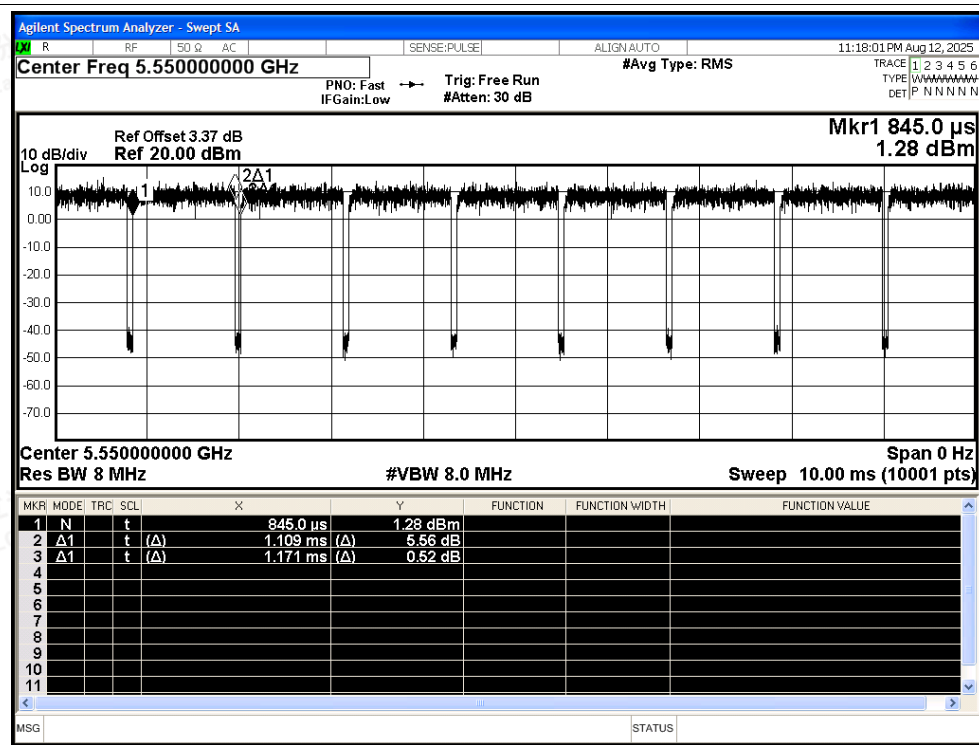

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5670MHz Ant1

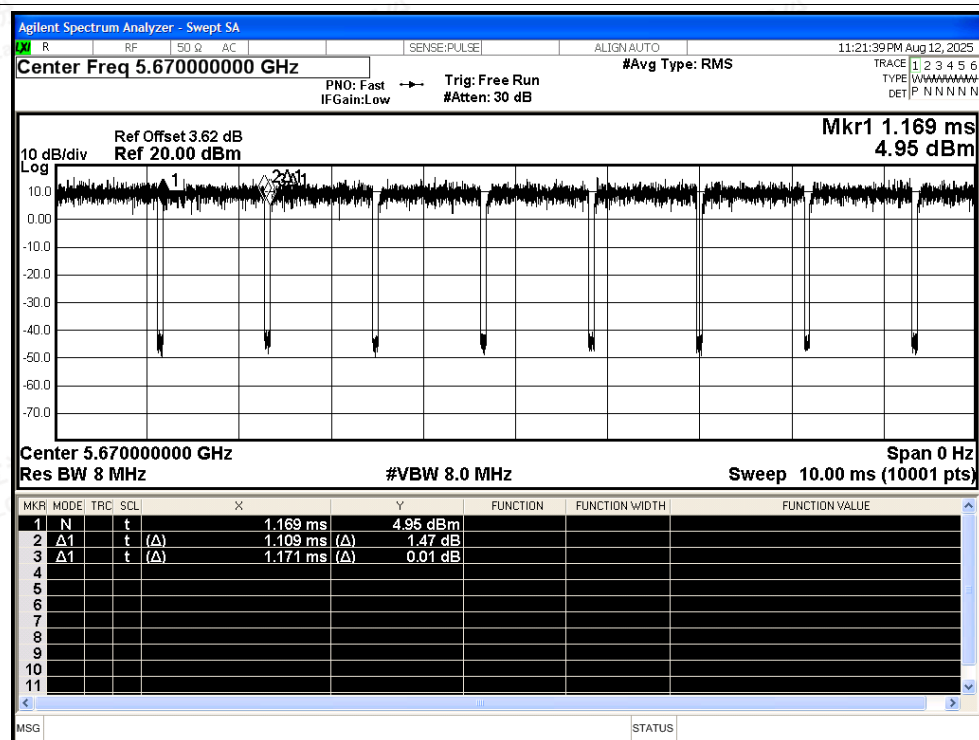

Duty Cycle NVNT ac20 5500MHz Ant1

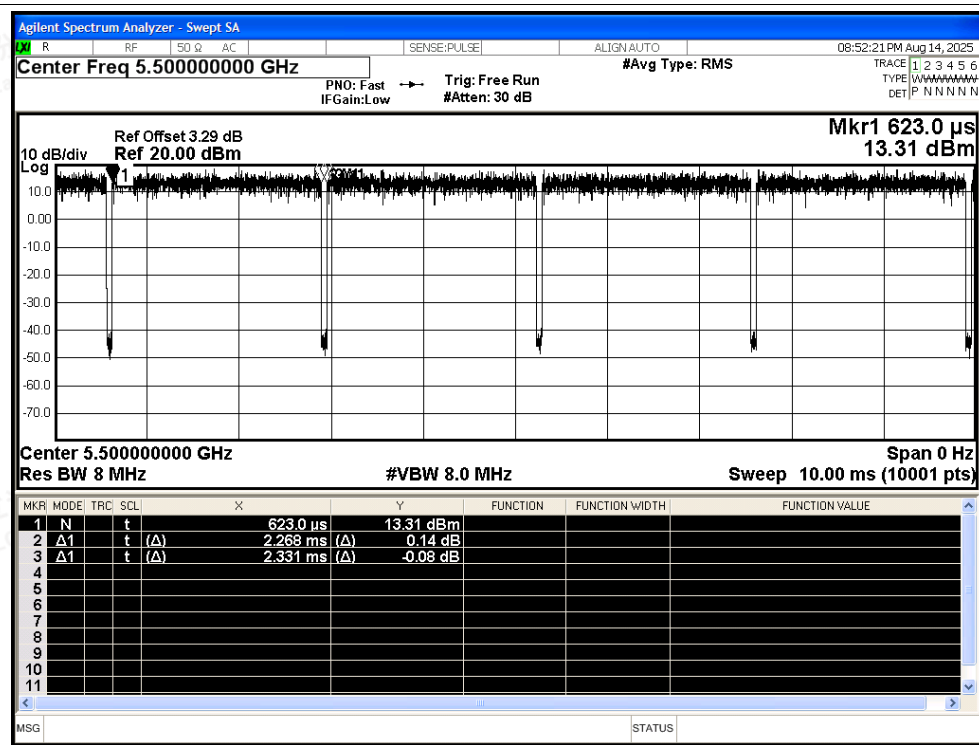

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5580MHz Ant1

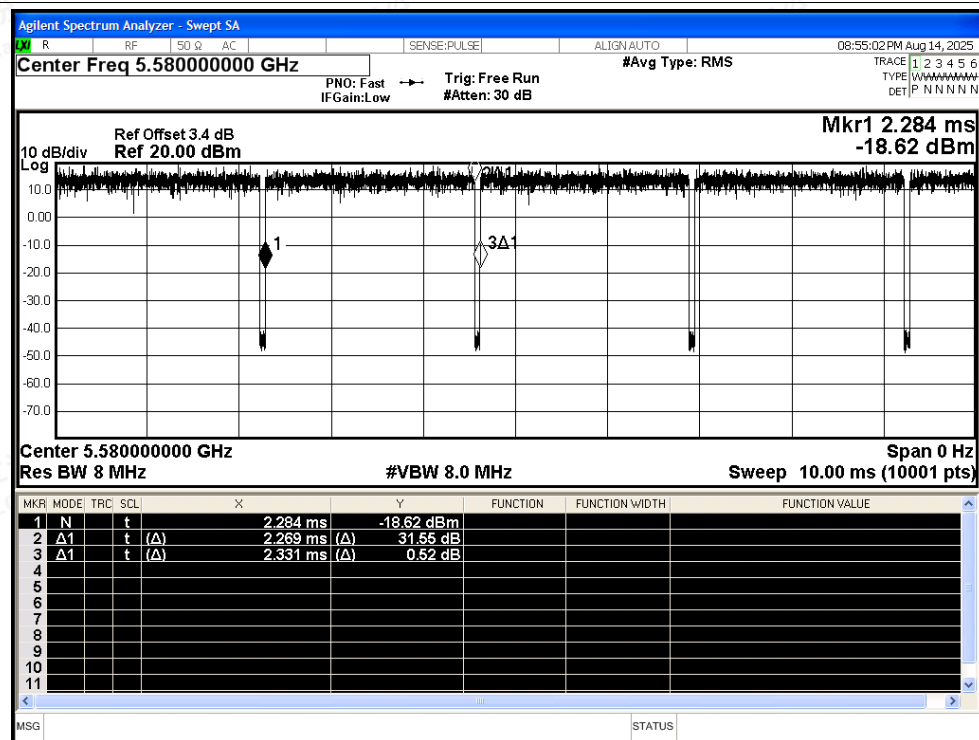

Duty Cycle NVNT ac20 5700MHz Ant1

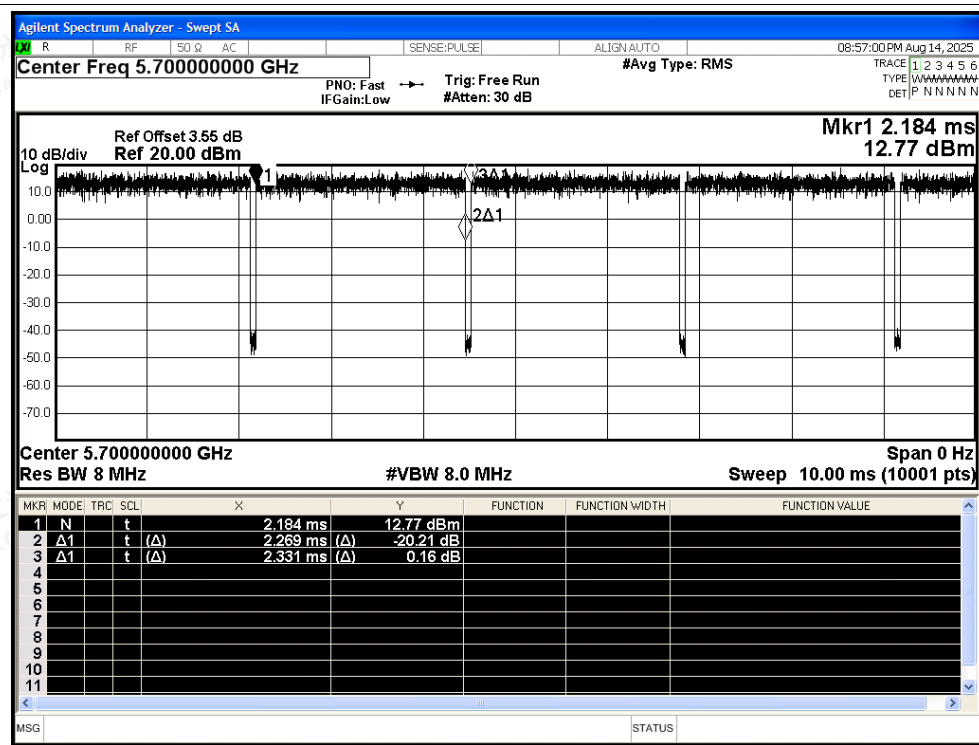

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5510MHz Ant1

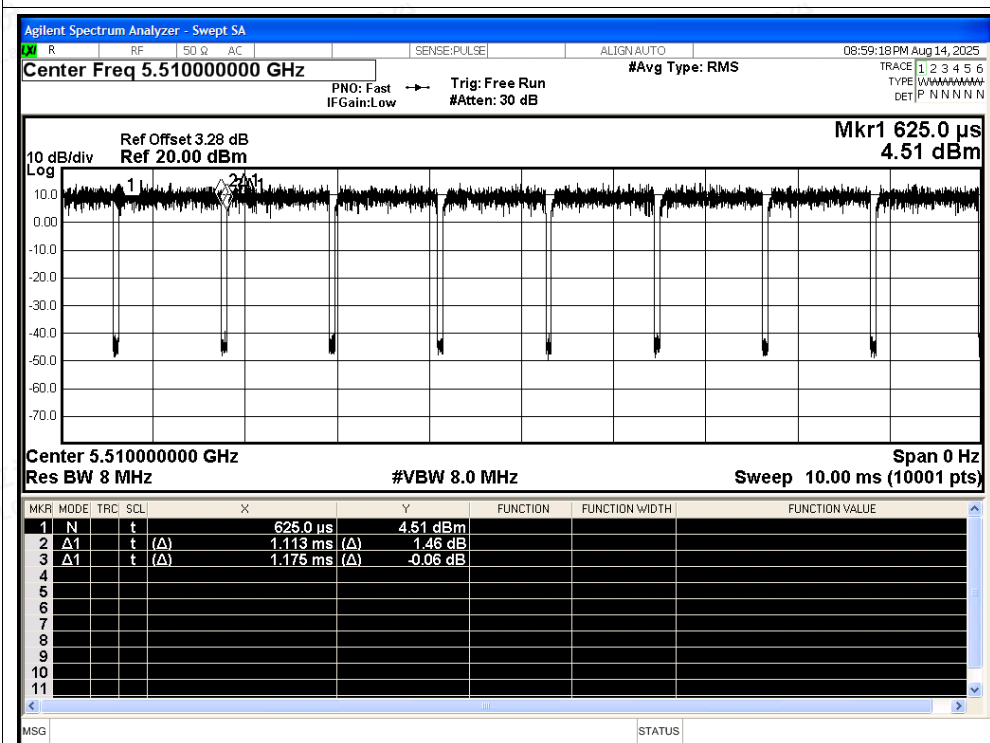

Duty Cycle NVNT ac40 5550MHz Ant1

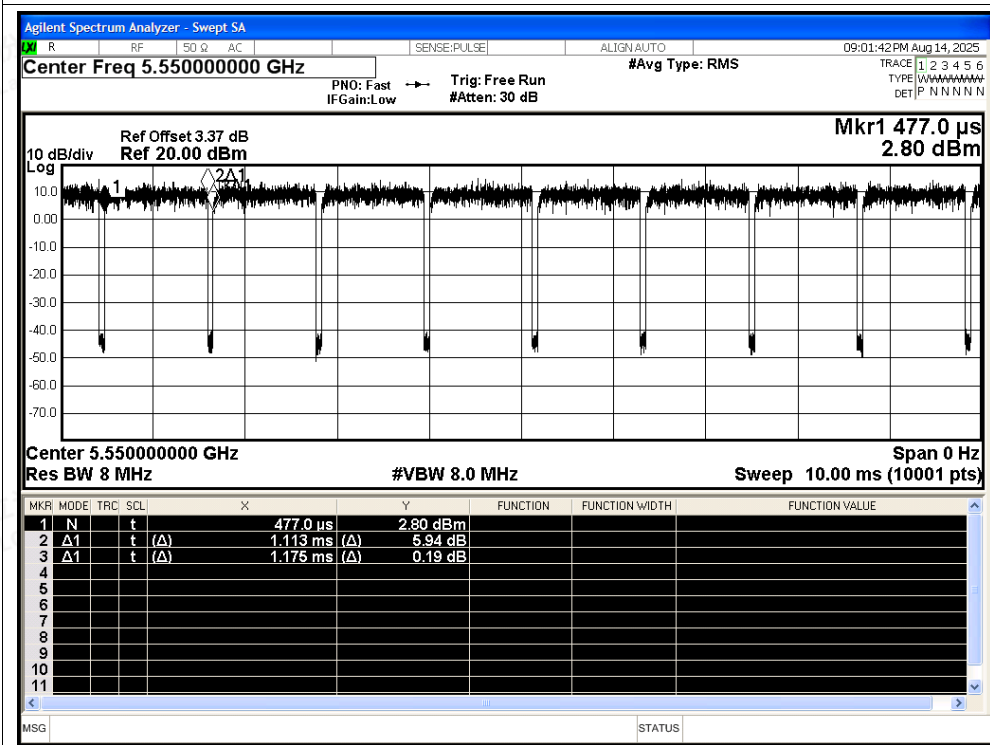

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5670MHz Ant1

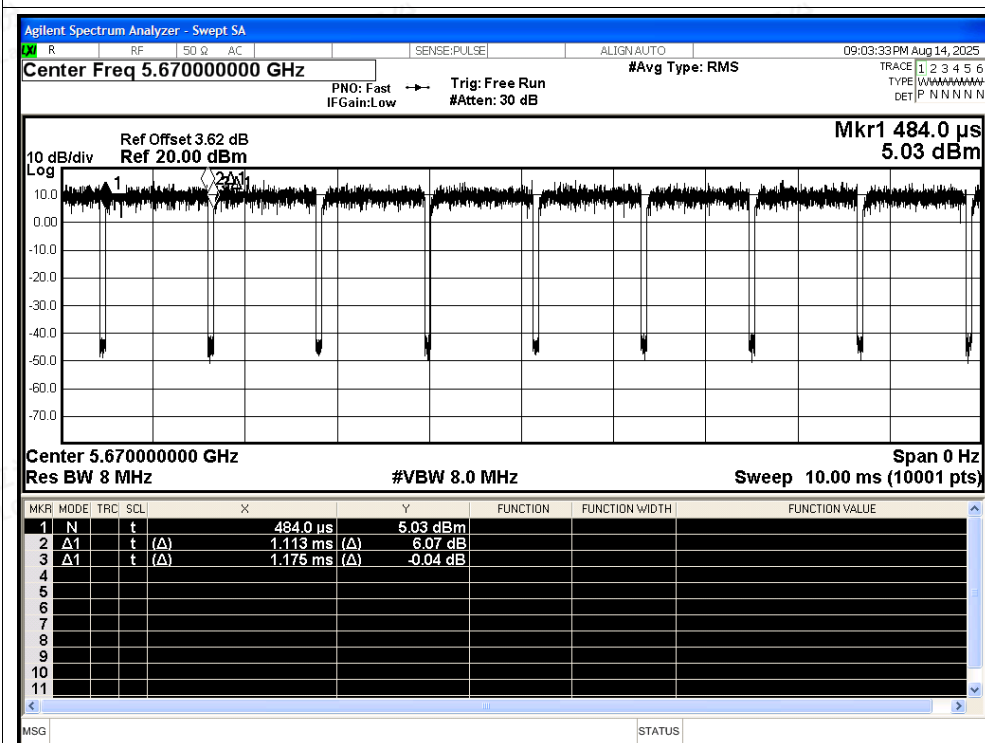

Duty Cycle NVNT ac80 5530MHz Ant1

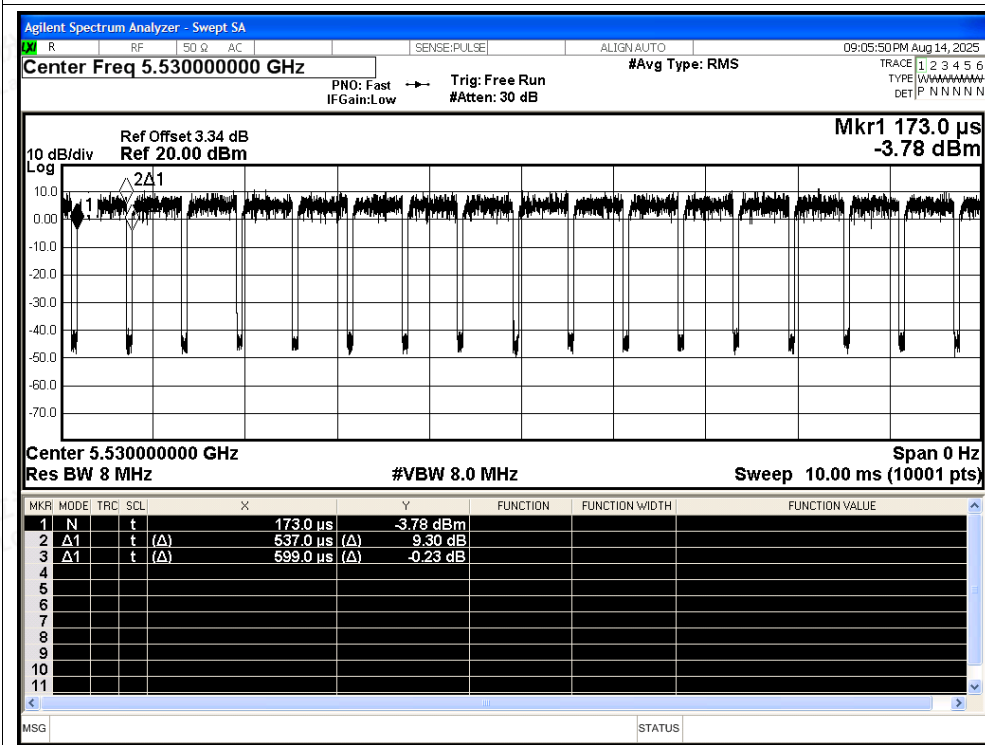


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

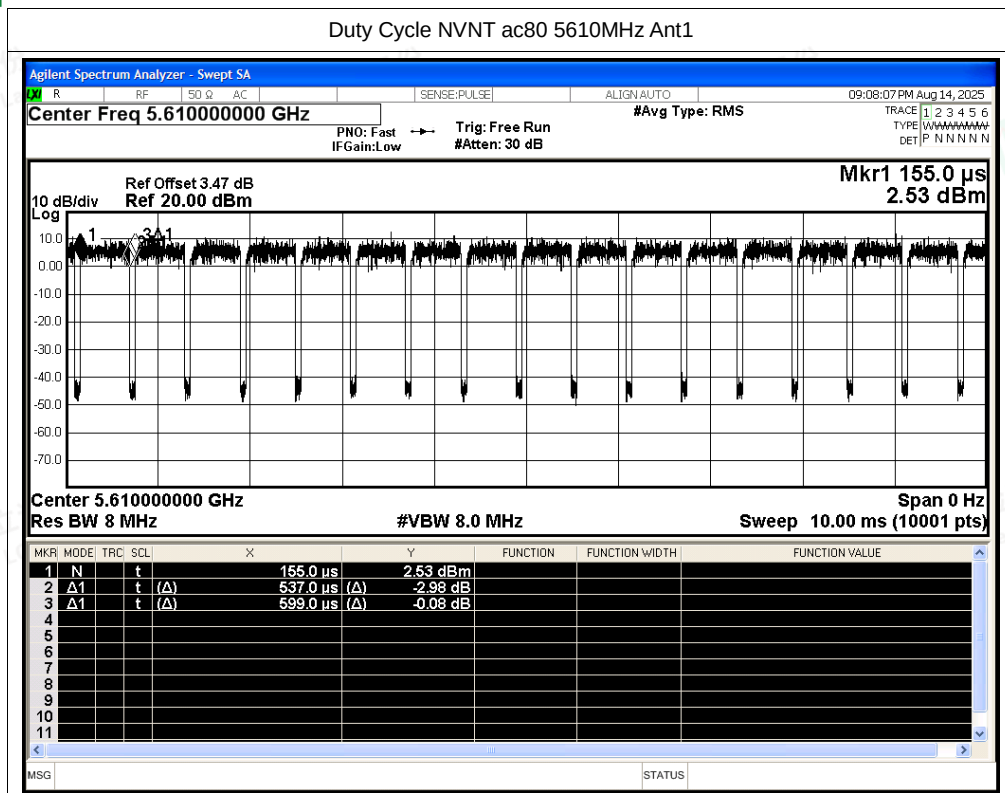

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5500	Ant2	94.56	0.24	0.91
NVNT	a	5580	Ant2	94.65	0.24	0.91
NVNT	a	5700	Ant2	94.56	0.24	0.91
NVNT	n20	5500	Ant2	97.29	0.12	0.44
NVNT	n20	5580	Ant2	97.29	0.12	0.44
NVNT	n20	5700	Ant2	97.33	0.12	0.44
NVNT	n40	5510	Ant2	94.71	0.24	0.9
NVNT	n40	5550	Ant2	94.71	0.24	0.9
NVNT	n40	5670	Ant2	94.71	0.24	0.9
NVNT	ac20	5500	Ant2	97.3	0.12	0.44
NVNT	ac20	5580	Ant2	97.34	0.12	0.44
NVNT	ac20	5700	Ant2	97.34	0.12	0.44
NVNT	ac40	5510	Ant2	94.72	0.24	0.9
NVNT	ac40	5550	Ant2	94.72	0.24	0.9
NVNT	ac40	5670	Ant2	94.72	0.24	0.9
NVNT	ac80	5530	Ant2	89.65	0.47	1.86
NVNT	ac80	5610	Ant2	89.65	0.47	1.86



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5500MHz Ant2

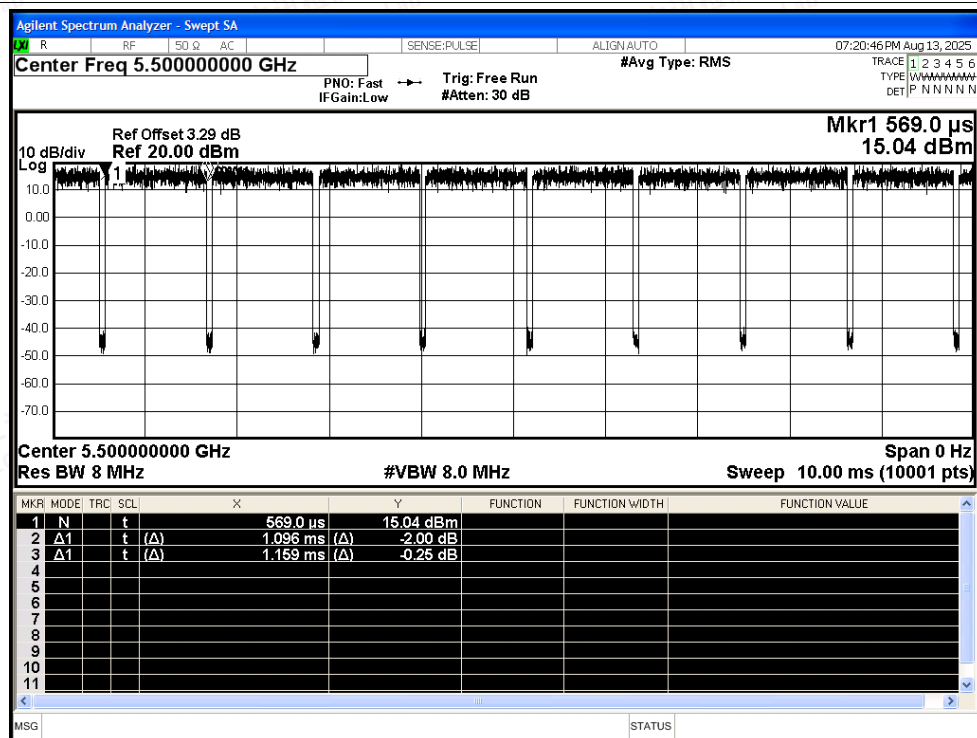

Duty Cycle NVNT a 5580MHz Ant2

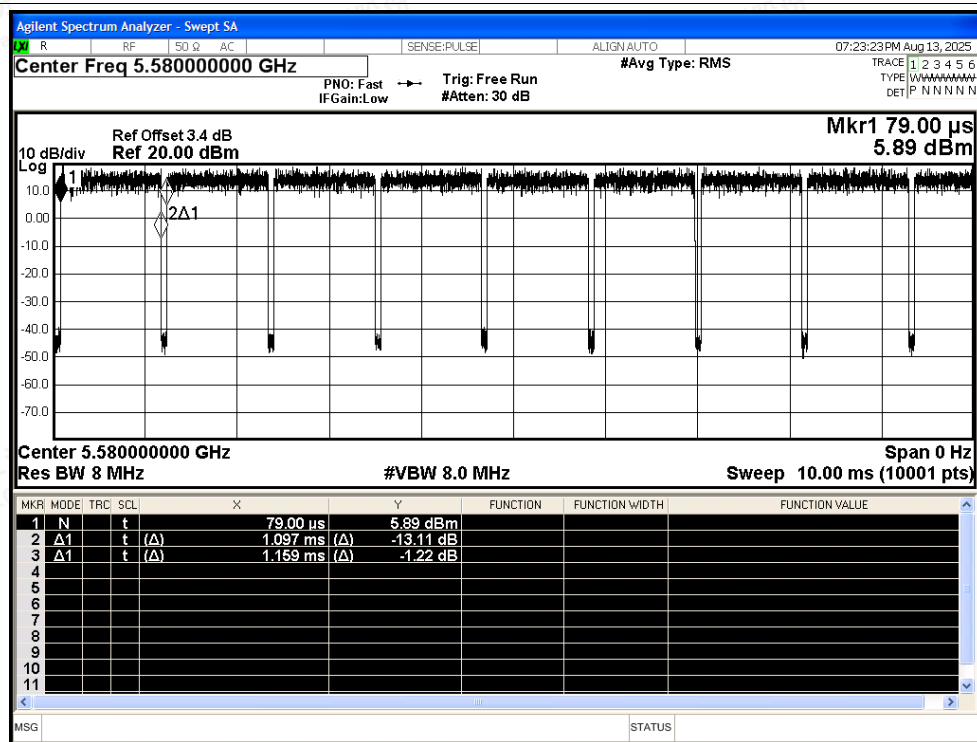

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5700MHz Ant2

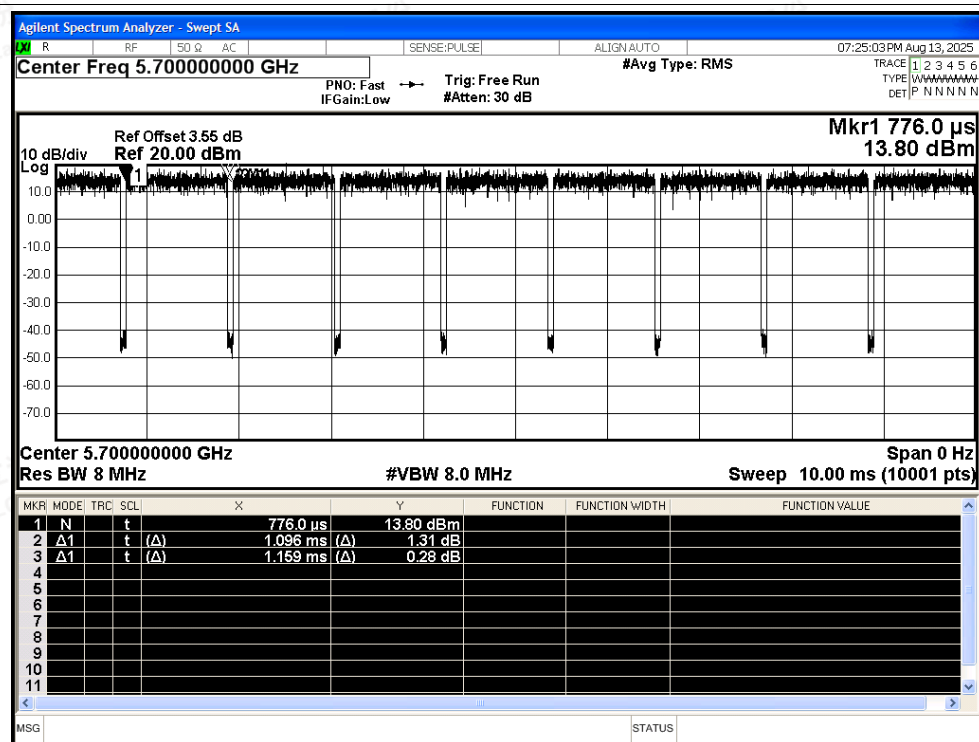

Duty Cycle NVNT n20 5500MHz Ant2

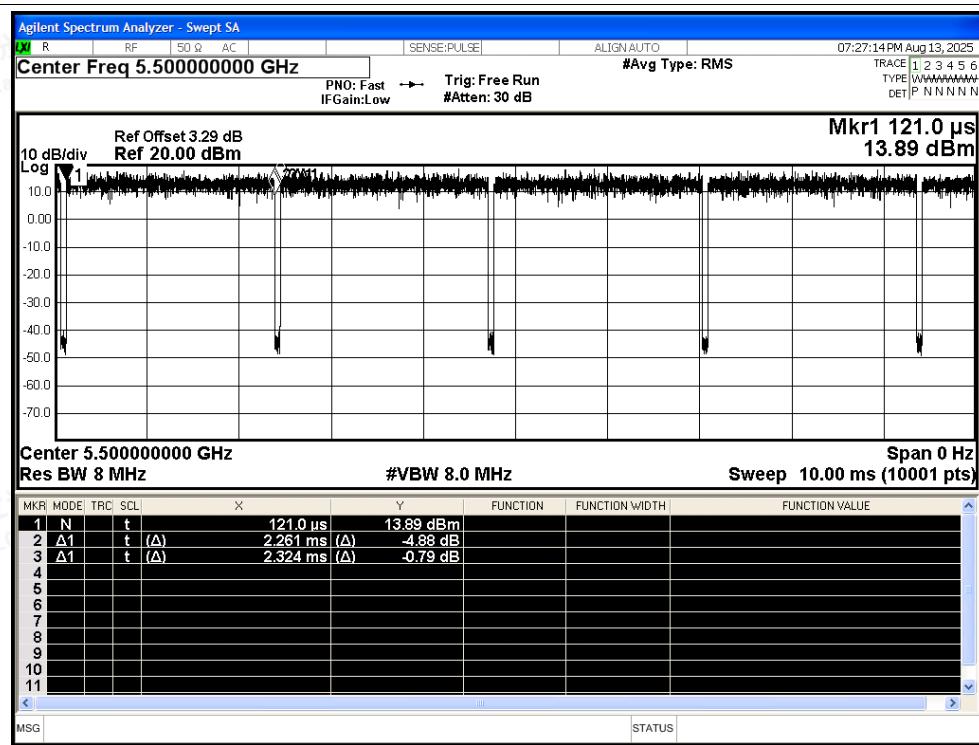

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5580MHz Ant2

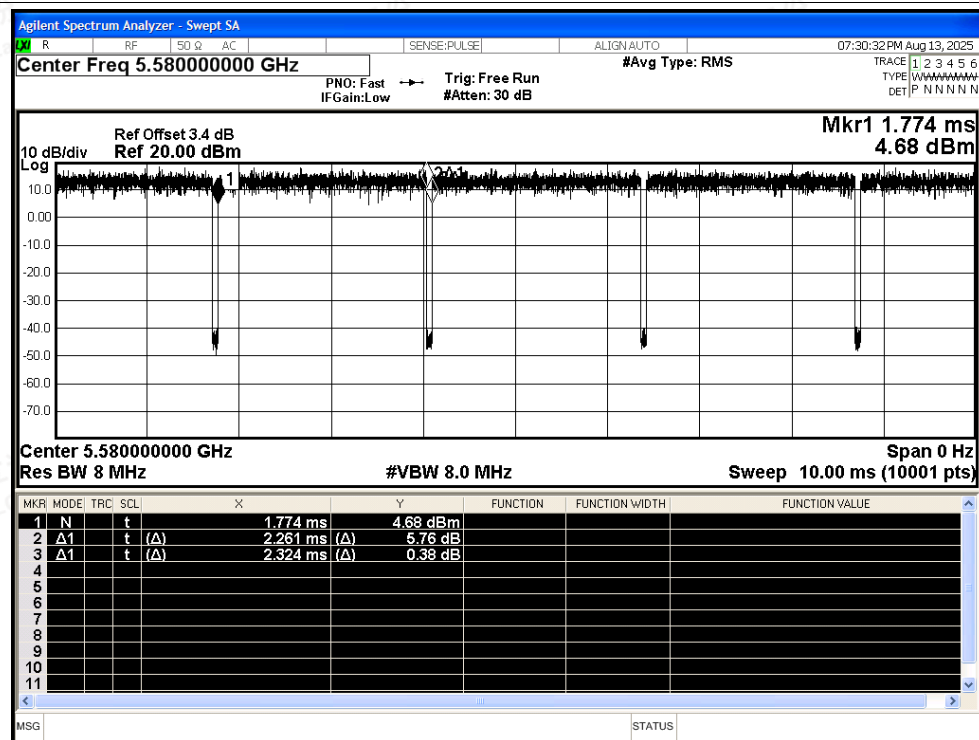

Duty Cycle NVNT n20 5700MHz Ant2

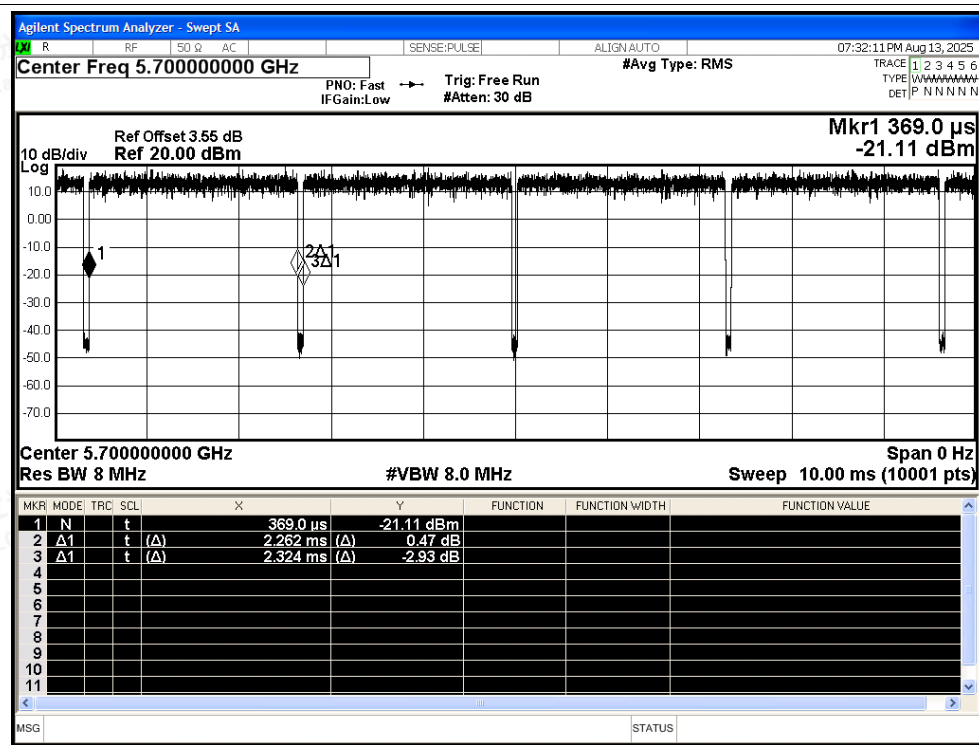

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5510MHz Ant2

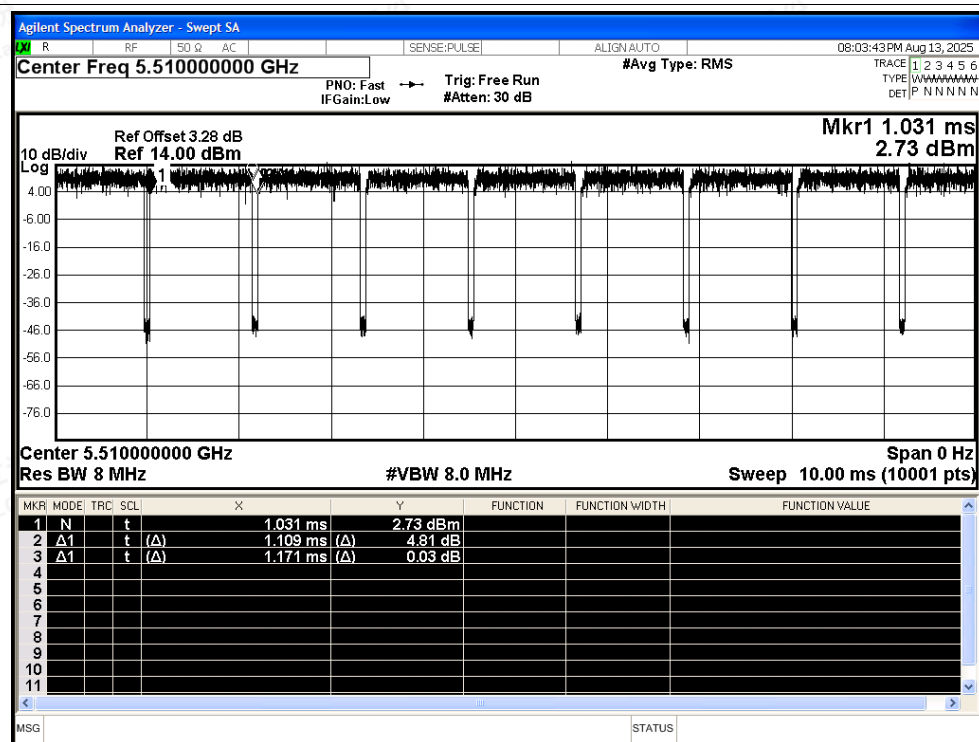

Duty Cycle NVNT n40 5550MHz Ant2

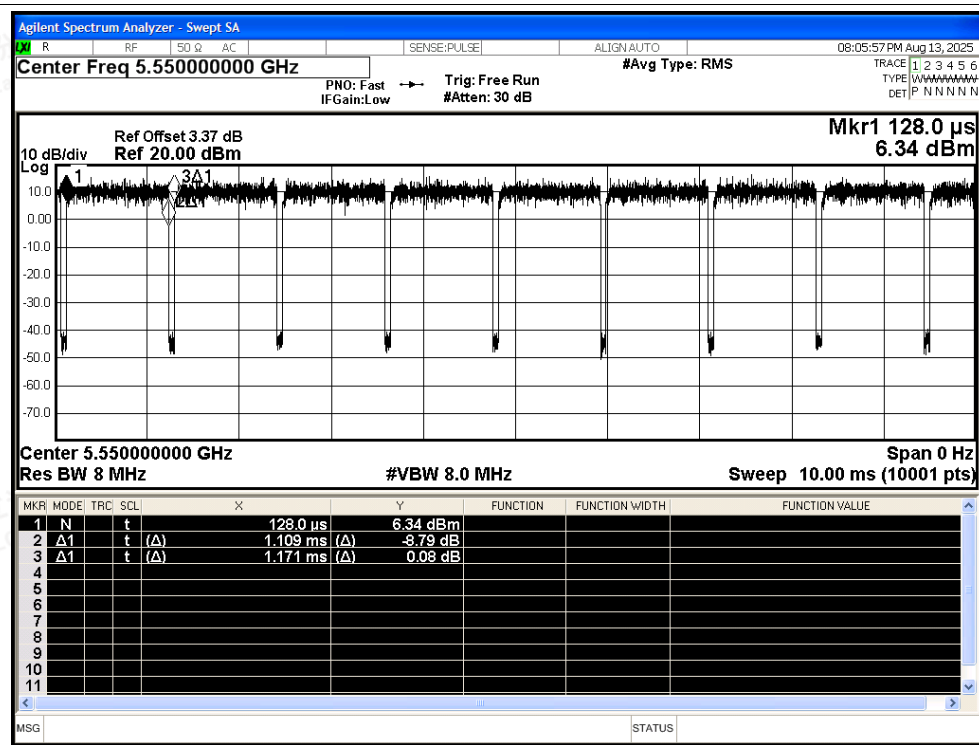

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5670MHz Ant2

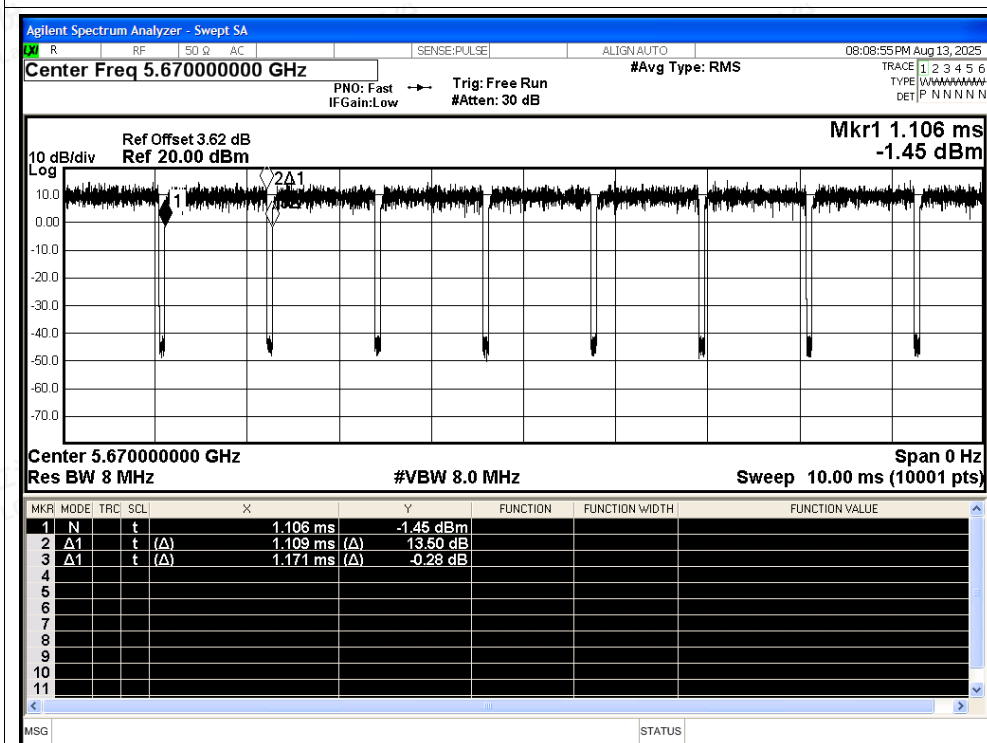

Duty Cycle NVNT ac20 5500MHz Ant2

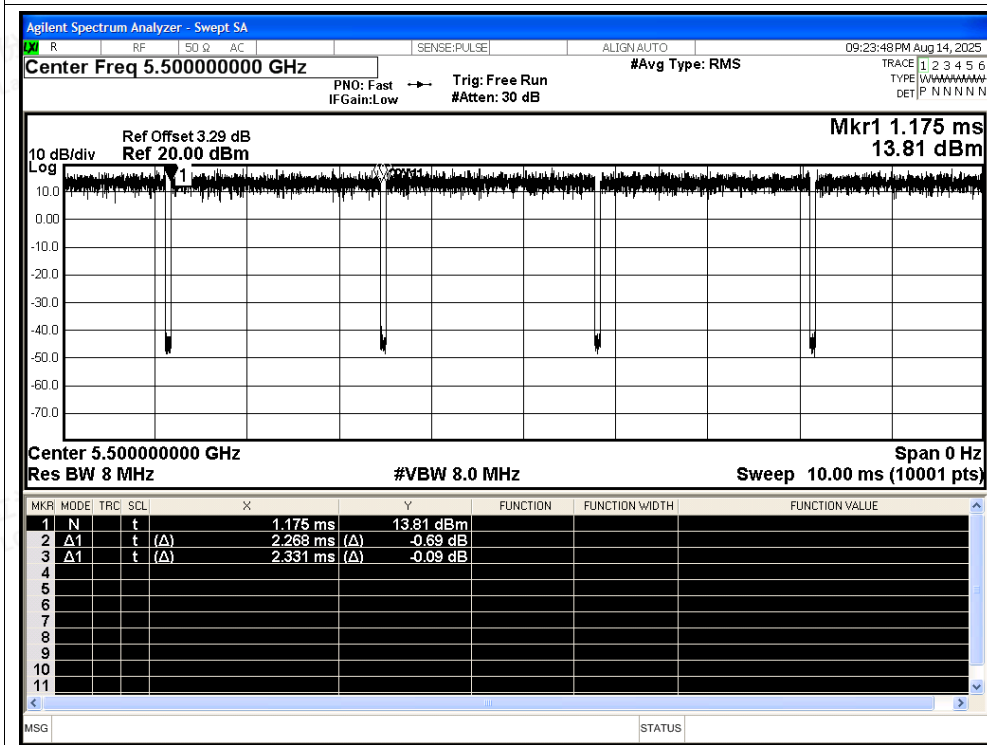

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5580MHz Ant2

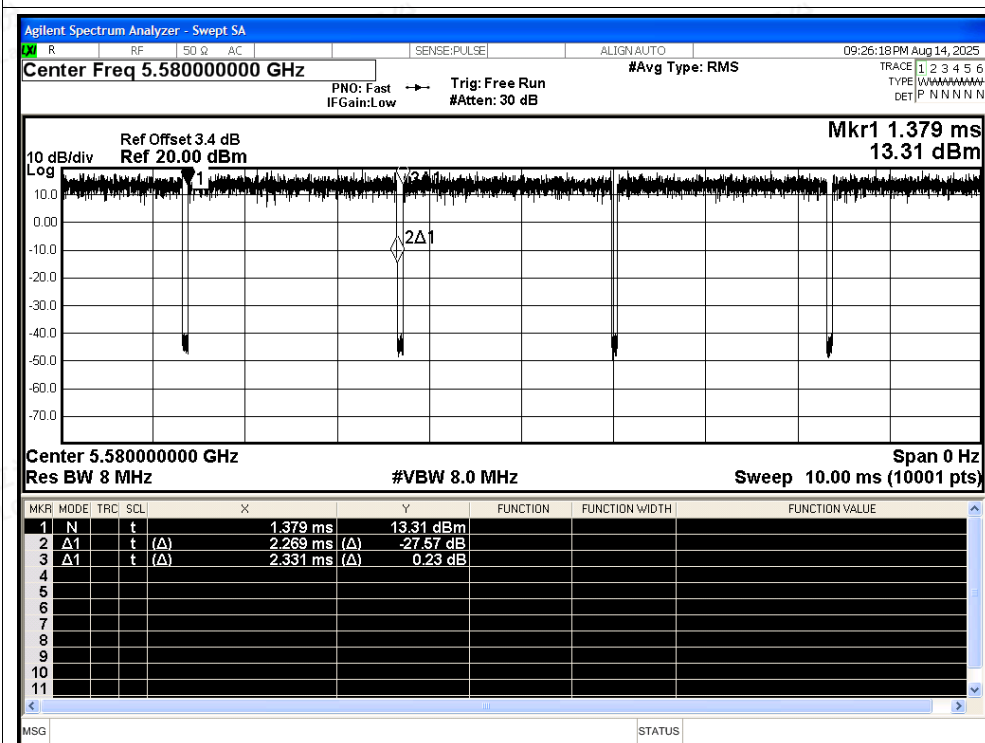

Duty Cycle NVNT ac20 5700MHz Ant2

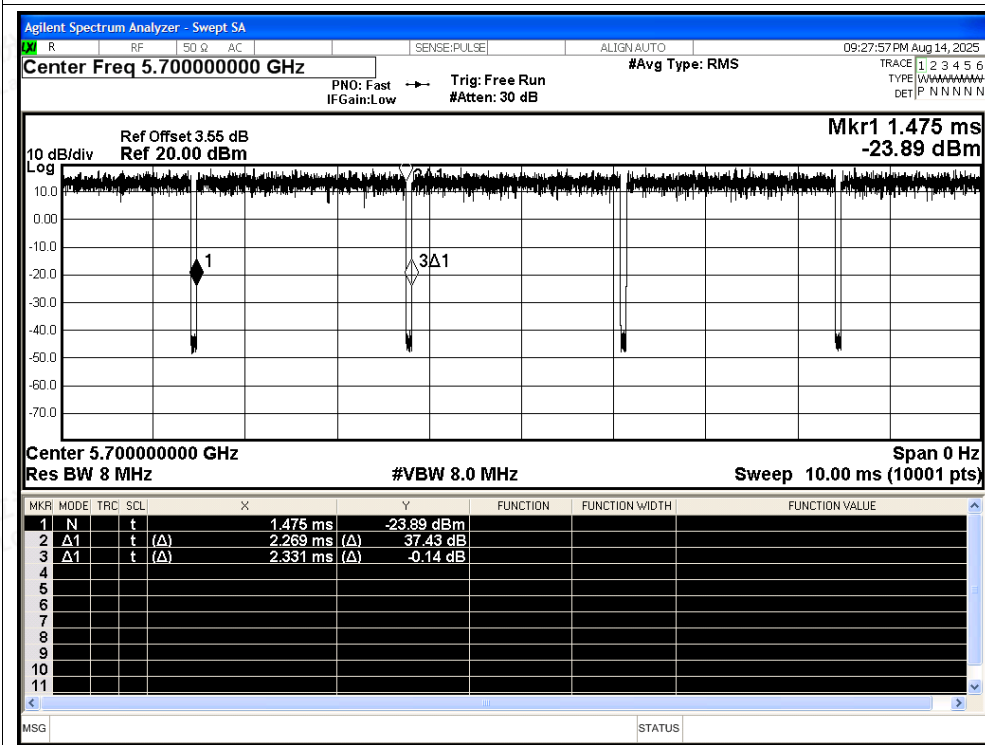

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5510MHz Ant2

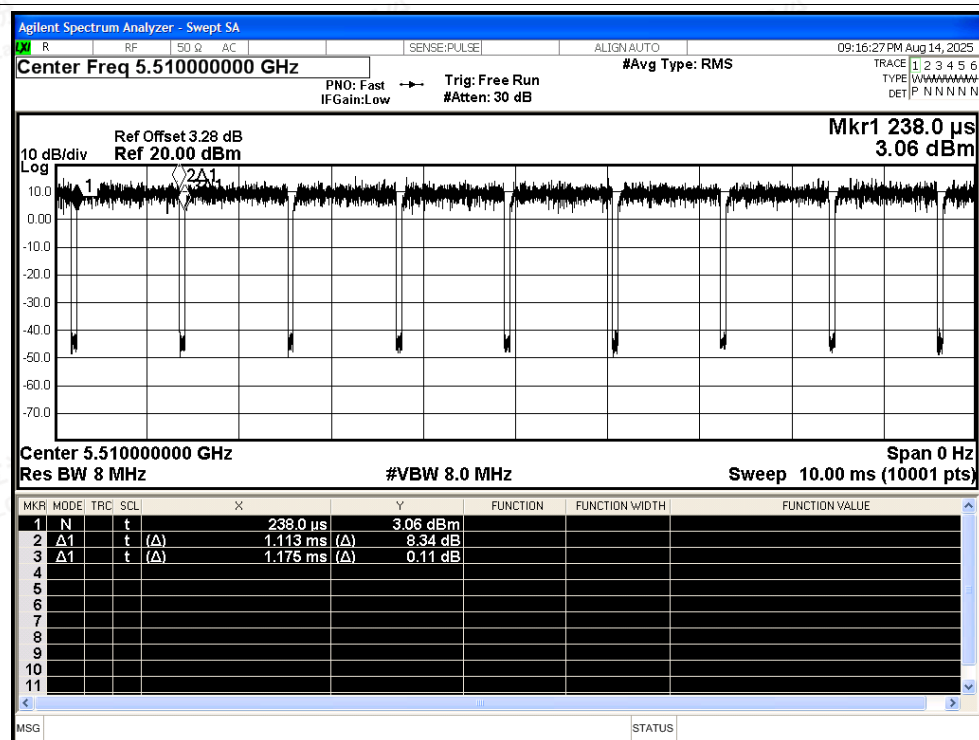

Duty Cycle NVNT ac40 5550MHz Ant2

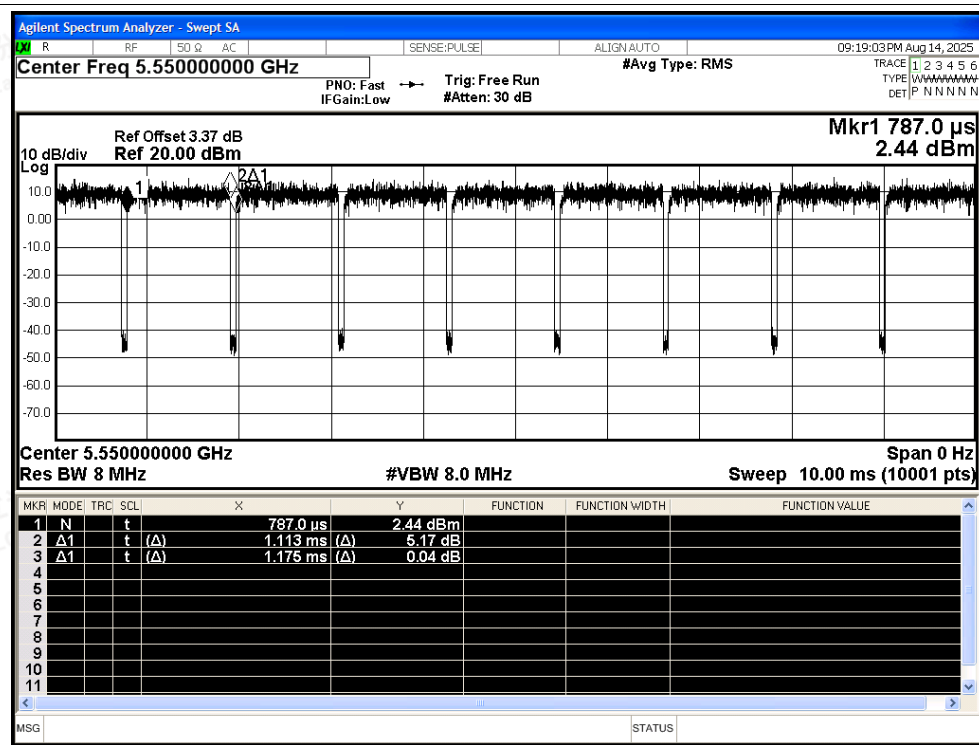

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5670MHz Ant2

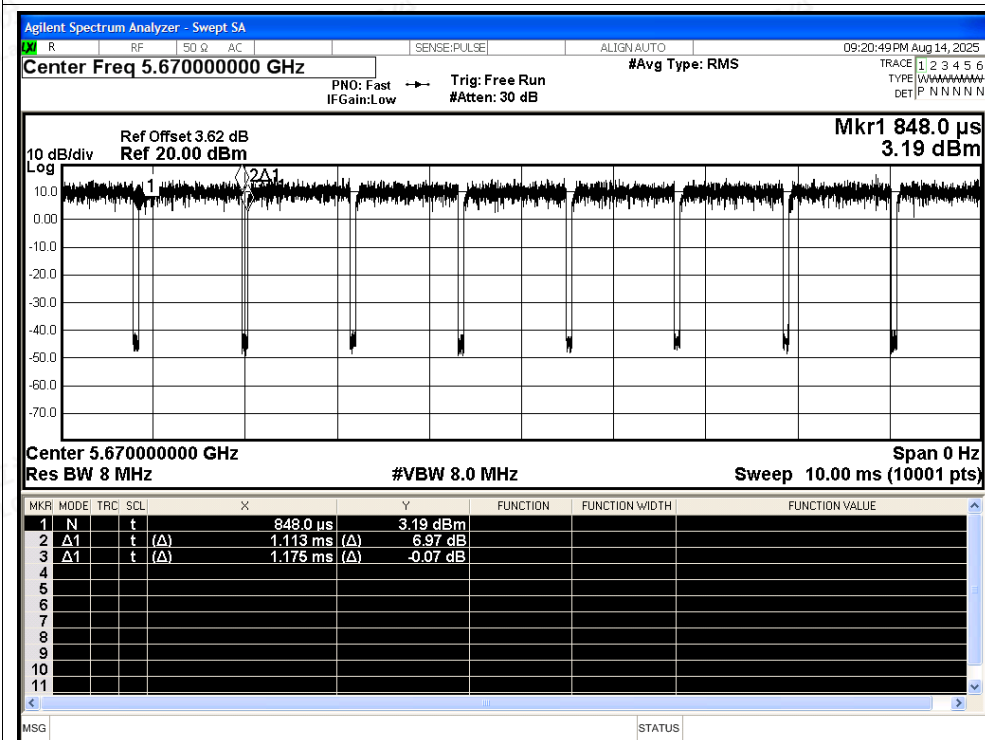

Duty Cycle NVNT ac80 5530MHz Ant2

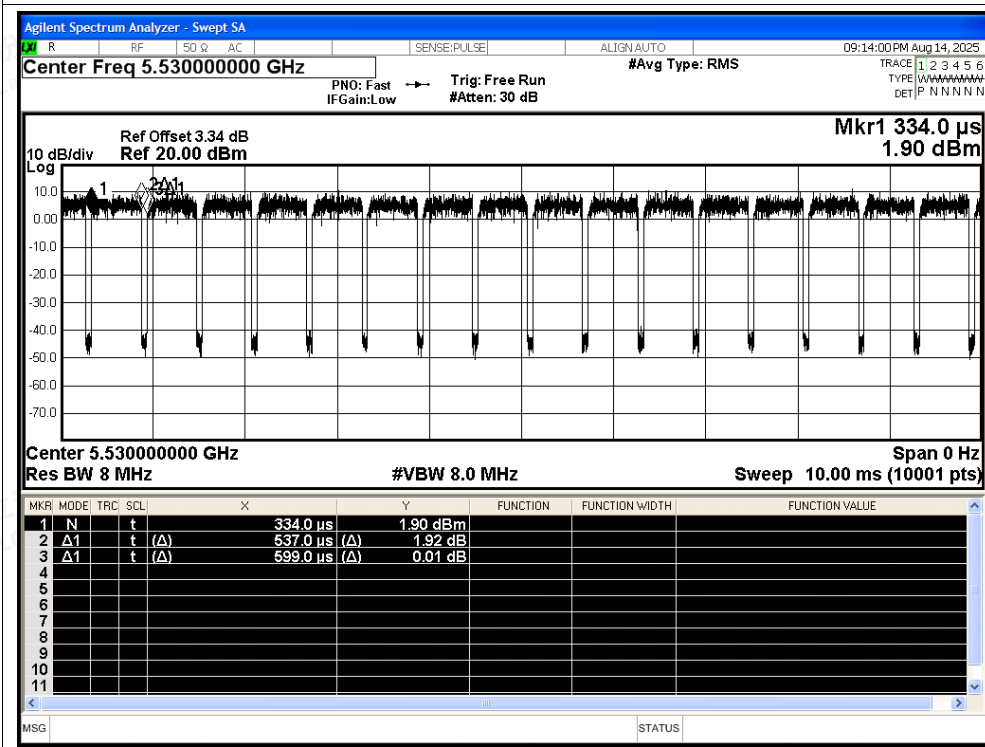


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

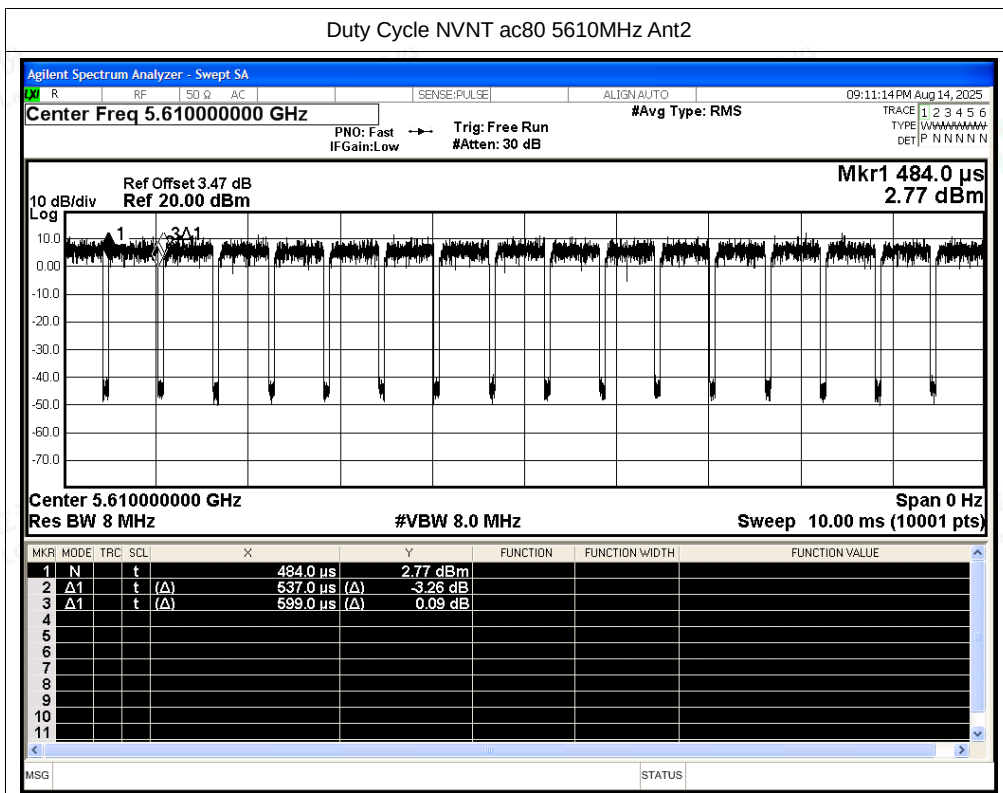

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity