




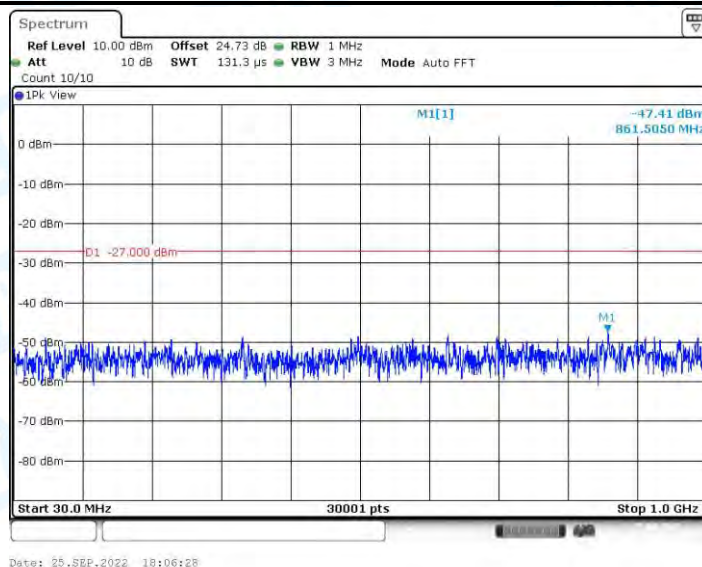


11AX80-SDM\_Ant1\_5610\_1000~40000

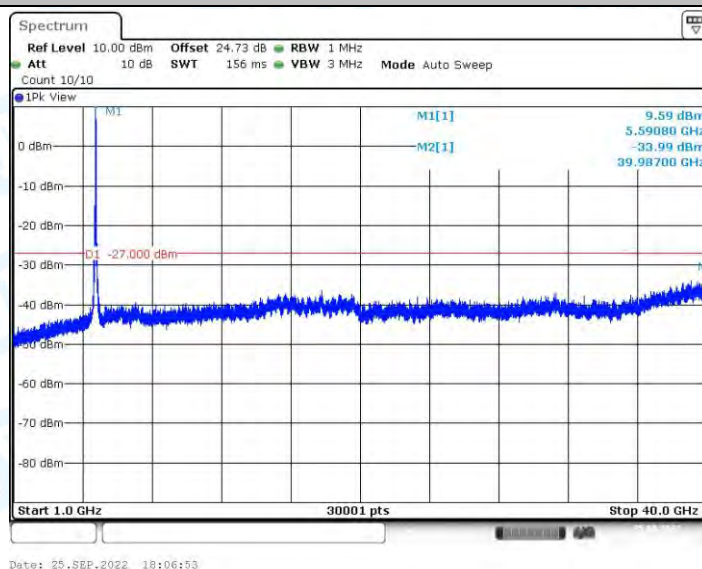


11AX80-SDM\_Ant2\_5610\_30~1000

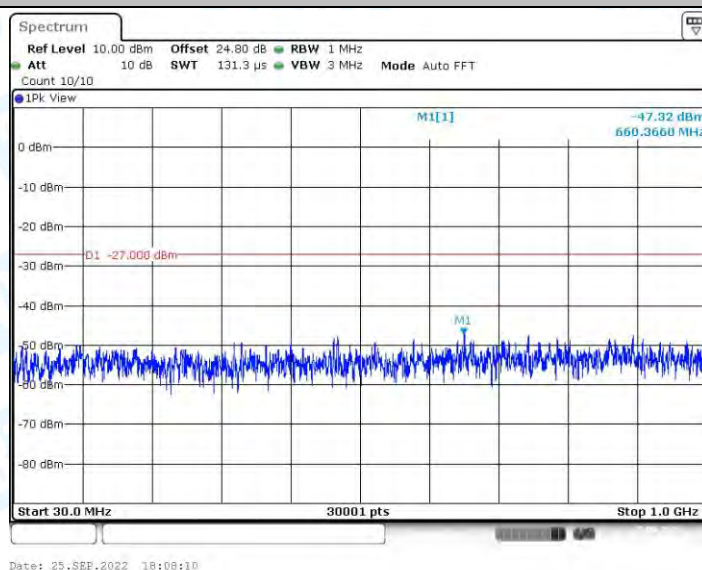


11AX80-SDM\_Ant2\_5610\_1000~40000

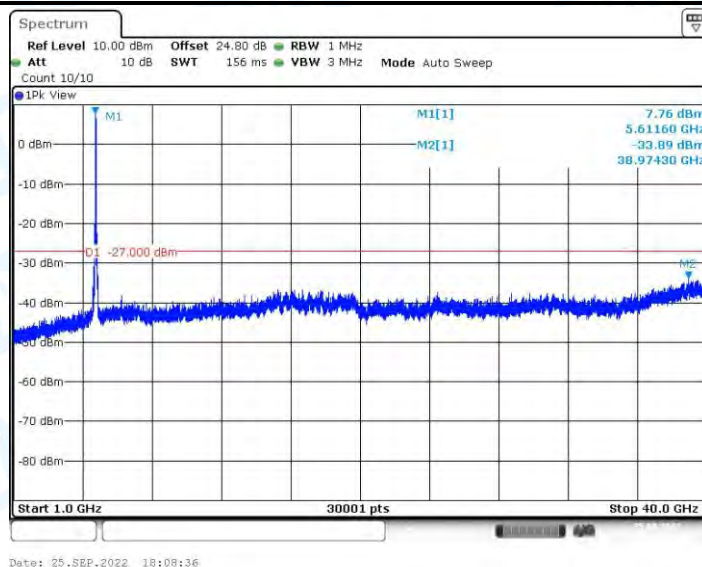


11AX80-SDM\_Ant1\_5690\_30~1000

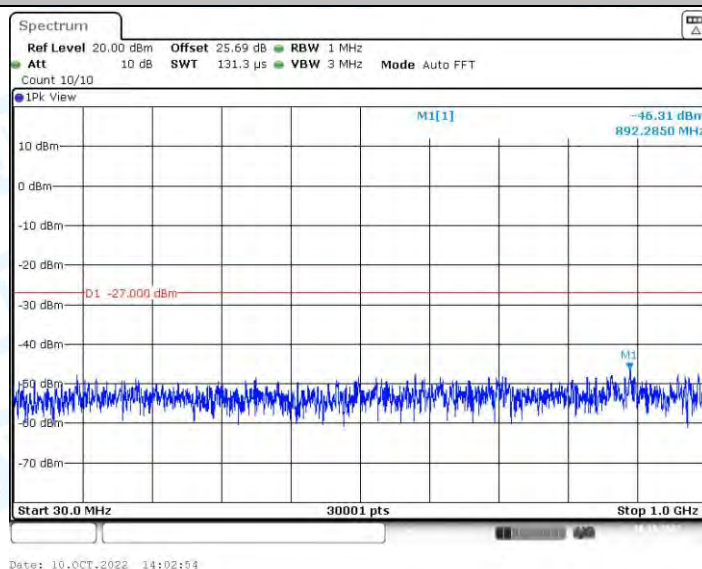


11AX80-SDM\_Ant1\_5690\_1000~40000

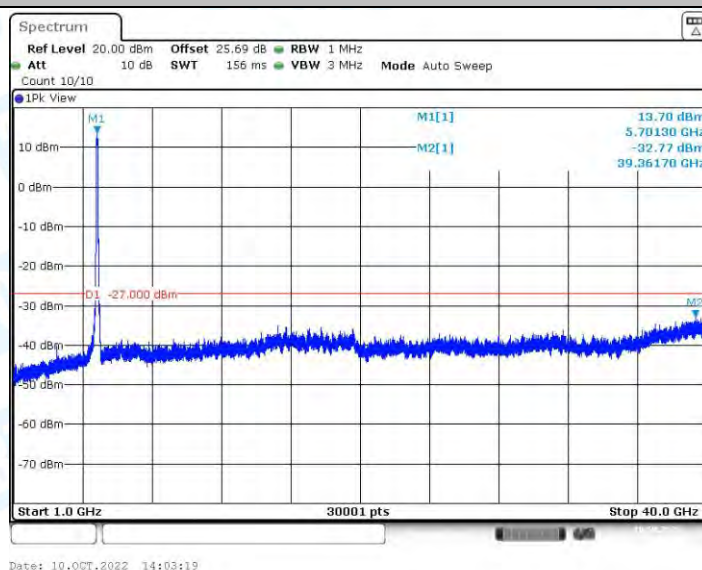


11AX80-SDM\_Ant2\_5690\_30~1000

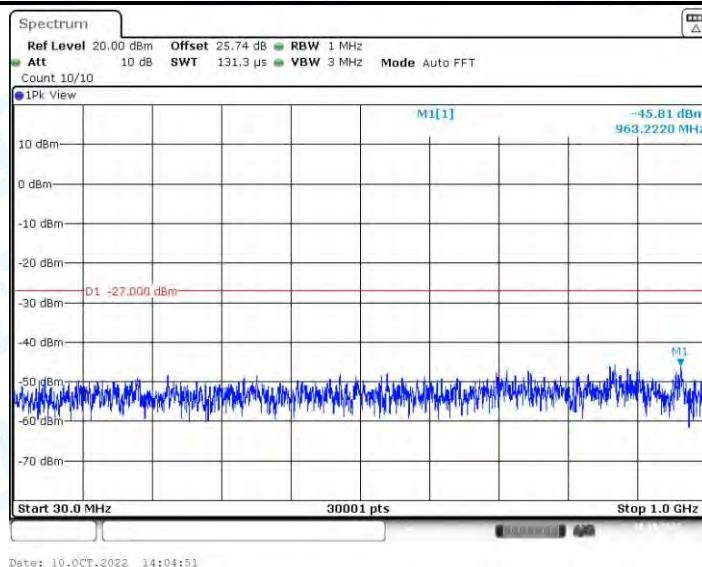


11AX80-SDM\_Ant2\_5690\_1000~40000

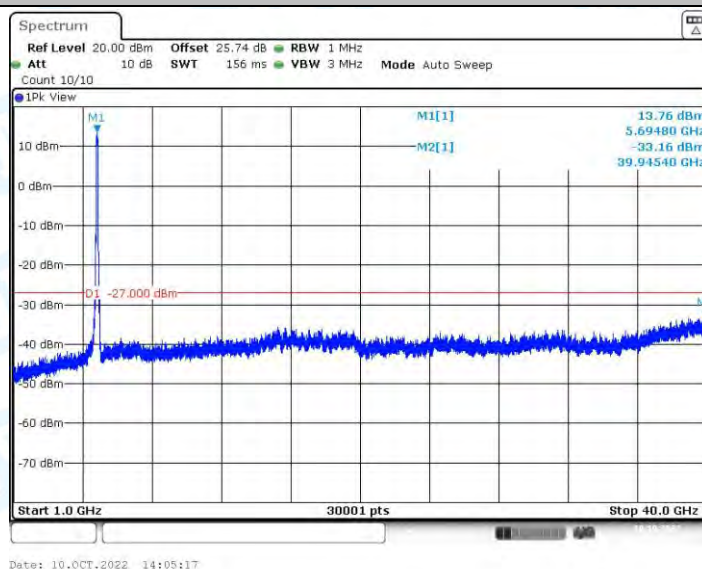


11AX80-SDM\_Ant1\_5775\_30~1000

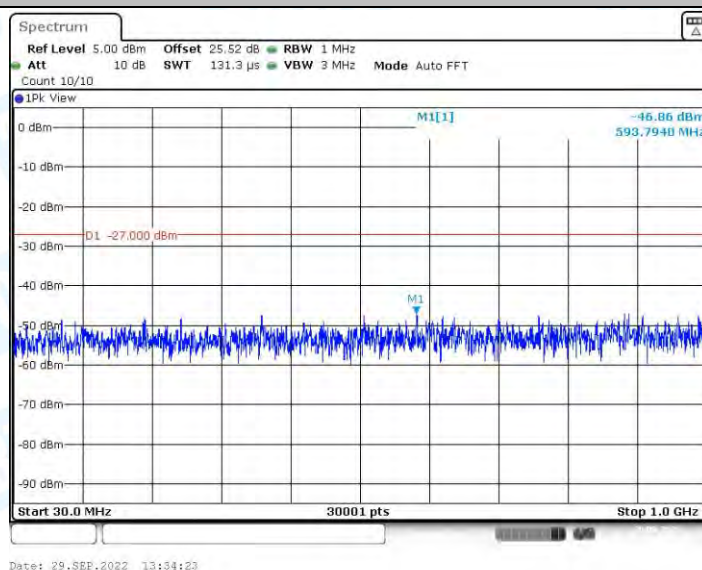


11AX80-SDM\_Ant1\_5775\_1000~40000

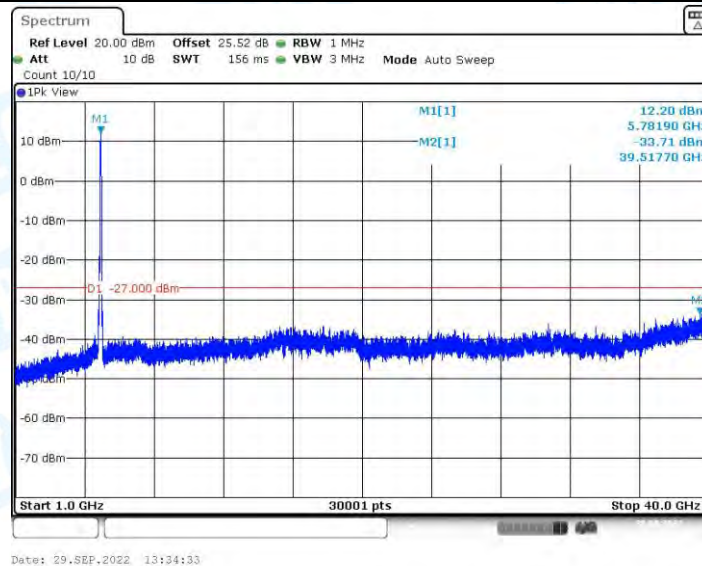


11AX80-SDM\_Ant2\_5775\_30~1000

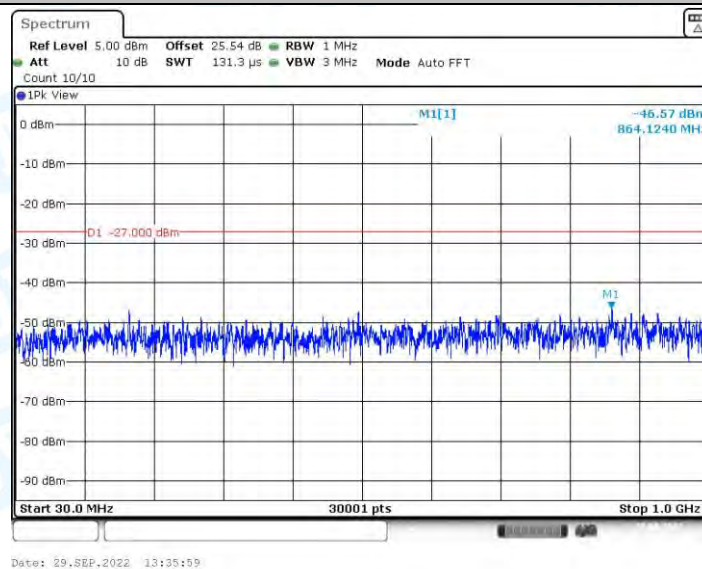


11AX80-SDM\_Ant2\_5775\_1000~40000

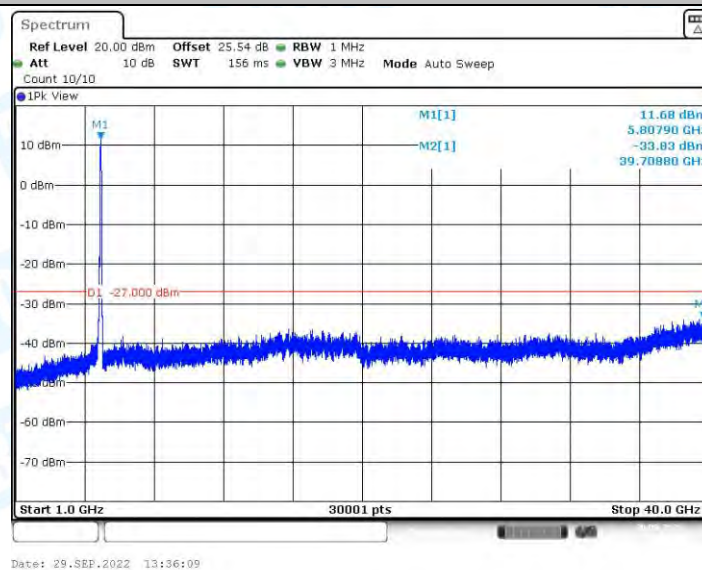


11AX160-SDM\_Ant1\_5250\_30~1000

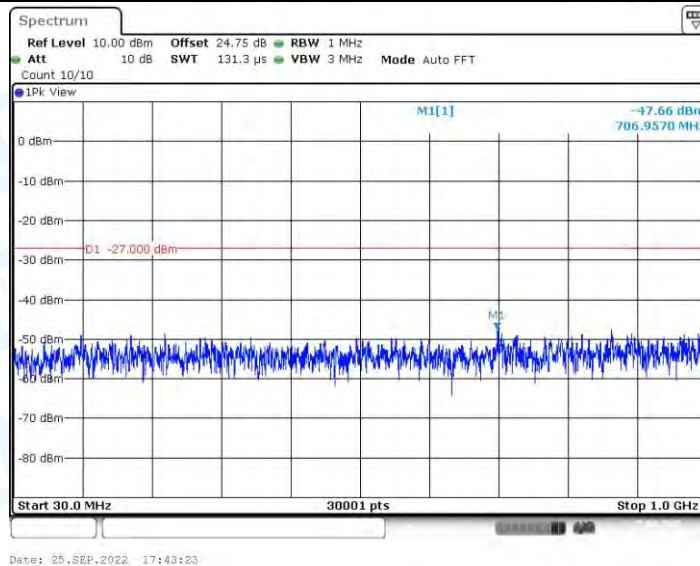


11AX160-SDM\_Ant1\_5250\_1000~40000

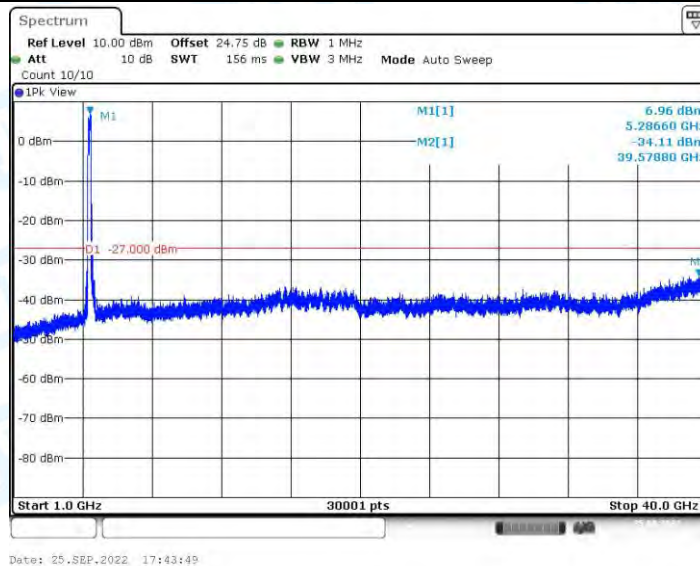


11AX160-SDM\_Ant2\_5250\_30~1000

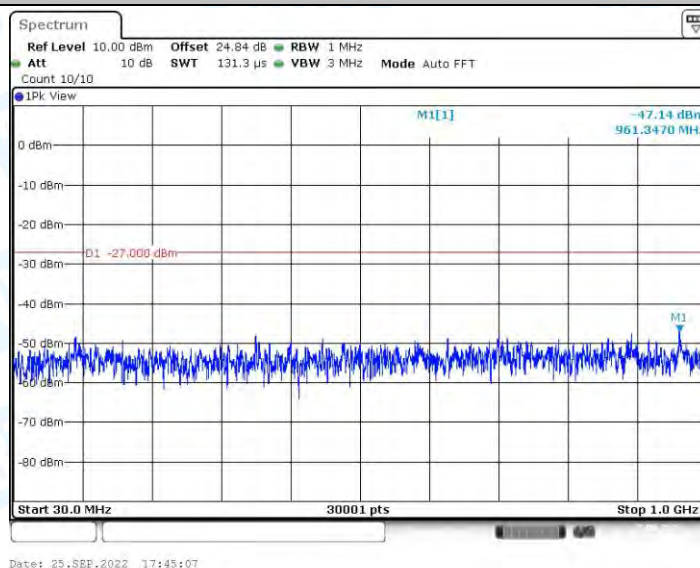


11AX160-SDM\_Ant2\_5250\_1000~40000

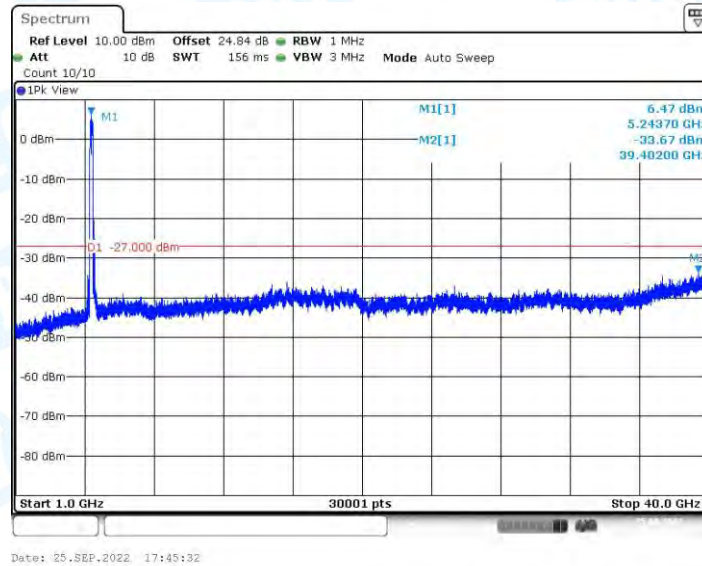


11AX160-SDM\_Ant1\_5570\_30~1000

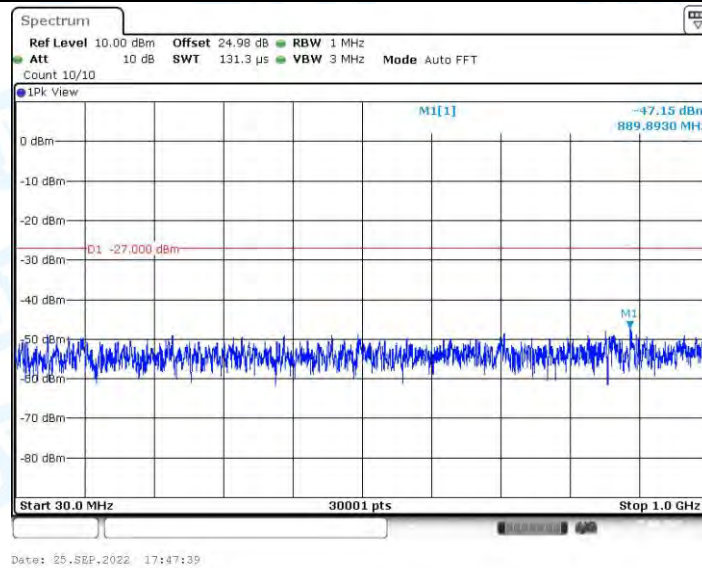


11AX160-SDM\_Ant1\_5570\_1000~40000

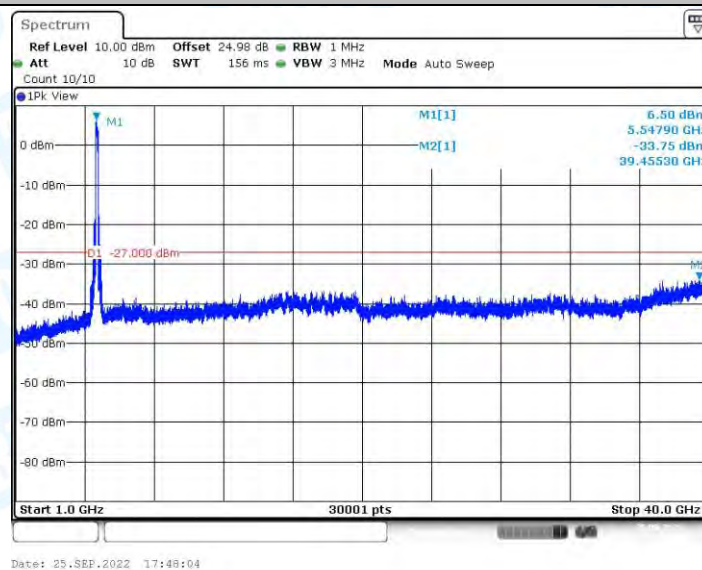

11AX160-SDM\_Ant2\_5570\_30~1000

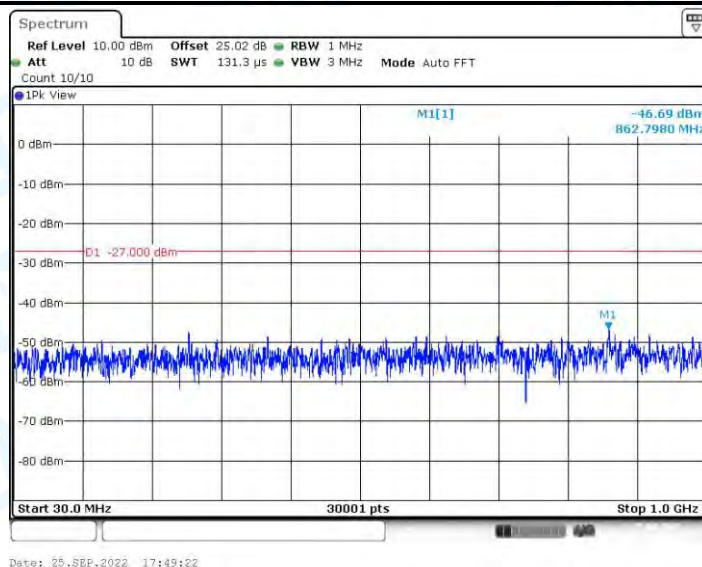

### 11AX160-SDM\_Ant2\_5570\_1000~40000

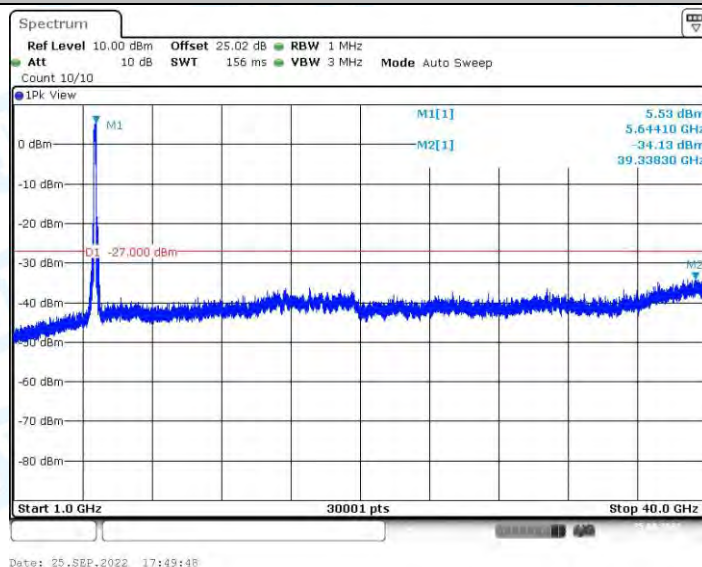

## 8. Frequency Stability

### 8.1. Test Result (only show the worst data)

| TestMode    | Channel | Voltage       |                  |                |                 |             | Verdict |
|-------------|---------|---------------|------------------|----------------|-----------------|-------------|---------|
|             |         | Voltage [Vac] | Temperature (°C) | Deviation (Hz) | Deviation (ppm) | Limit (ppm) |         |
| 11A         | 5180    | 120           | 20               | -20000.00      | -3.861004       | 20          | PASS    |
|             |         | 102           | 20               | -20000.00      | -3.861004       | 20          | PASS    |
|             |         | 138           | 20               | -20000.00      | -3.861004       | 20          | PASS    |
|             | 5260    | 120           | 20               | -20000.00      | -3.802281       | 20          | PASS    |
|             |         | 102           | 20               | -20000.00      | -3.802281       | 20          | PASS    |
|             |         | 138           | 20               | -20000.00      | -3.802281       | 20          | PASS    |
|             | 5500    | 120           | 20               | -20000.00      | -3.636364       | 20          | PASS    |
|             |         | 102           | 20               | -20000.00      | -3.636364       | 20          | PASS    |
|             |         | 138           | 20               | -20000.00      | -3.636364       | 20          | PASS    |
|             | 5745    | 120           | 20               | -20000.00      | -3.481288       | 20          | PASS    |
|             |         | 102           | 20               | -20000.00      | -3.481288       | 20          | PASS    |
|             |         | 138           | 20               | -20000.00      | -3.481288       | 20          | PASS    |
| 11N40-SDM   | 5190    | 120           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 102           | 20               | -40000.00      | -7.707129       | 20          | PASS    |
|             |         | 138           | 20               | -40000.00      | -7.707129       | 20          | PASS    |
|             | 5270    | 120           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 102           | 20               | -40000.00      | -7.590133       | 20          | PASS    |
|             |         | 138           | 20               | -40000.00      | -7.590133       | 20          | PASS    |
|             | 5510    | 120           | 20               | -40000.00      | -7.259528       | 20          | PASS    |
|             |         | 102           | 20               | -40000.00      | -7.259528       | 20          | PASS    |
|             |         | 138           | 20               | -40000.00      | -7.259528       | 20          | PASS    |
|             | 5670    | 120           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 102           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 138           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             | 5795    | 120           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 102           | 20               | -40000.00      | -6.902502       | 20          | PASS    |
|             |         | 138           | 20               | -40000.00      | -6.902502       | 20          | PASS    |
| 11AC80-SDM  | 5210    | 120           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 102           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 138           | 20               | 80000.00       | 15.355086       | 20          | PASS    |
|             | 5290    | 120           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 102           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 138           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             | 5530    | 120           | 20               | -80000.00      | -14.466546      | 20          | PASS    |
|             |         | 102           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 138           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             | 5610    | 120           | 20               | -80000.00      | -14.260250      | 20          | PASS    |
|             |         | 102           | 20               | -80000.00      | -14.260250      | 20          | PASS    |
|             |         | 138           | 20               | -80000.00      | -14.260250      | 20          | PASS    |
|             | 5775    | 120           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 102           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 138           | 20               | 80000.00       | 13.852814       | 20          | PASS    |
| 11AX160-SDM | 5250    | 120           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 102           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 138           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             | 5570    | 120           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 102           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 138           | 20               | 0.00           | 0.000000        | 20          | PASS    |

| Temperature |         |               |                  |                |                 |             |         |
|-------------|---------|---------------|------------------|----------------|-----------------|-------------|---------|
| TestMode    | Channel | Voltage [Vac] | Temperature (°C) | Deviation (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
| 11A         | 5180    | 120           | 5                | -20000.00      | -3.861004       | 20          | PASS    |
|             |         | 120           | 10               | -20000.00      | -3.861004       | 20          | PASS    |
|             |         | 120           | 20               | -20000.00      | -3.861004       | 20          | PASS    |
|             |         | 120           | 30               | -20000.00      | -3.861004       | 20          | PASS    |
|             |         | 120           | 40               | -20000.00      | -3.861004       | 20          | PASS    |
|             | 5260    | 120           | 5                | -20000.00      | -3.802281       | 20          | PASS    |
|             |         | 120           | 10               | -20000.00      | -3.802281       | 20          | PASS    |
|             |         | 120           | 20               | -20000.00      | -3.802281       | 20          | PASS    |
|             |         | 120           | 30               | -20000.00      | -3.802281       | 20          | PASS    |
|             |         | 120           | 40               | -20000.00      | -3.802281       | 20          | PASS    |
|             | 5500    | 120           | 5                | -20000.00      | -3.636364       | 20          | PASS    |
|             |         | 120           | 10               | -20000.00      | -3.636364       | 20          | PASS    |
|             |         | 120           | 20               | -20000.00      | -3.636364       | 20          | PASS    |
|             |         | 120           | 30               | -20000.00      | -3.636364       | 20          | PASS    |
|             |         | 120           | 40               | -20000.00      | -3.636364       | 20          | PASS    |
|             | 5745    | 120           | 5                | -20000.00      | -3.481288       | 20          | PASS    |
|             |         | 120           | 10               | -20000.00      | -3.481288       | 20          | PASS    |
|             |         | 120           | 20               | -20000.00      | -3.481288       | 20          | PASS    |
|             |         | 120           | 30               | -20000.00      | -3.481288       | 20          | PASS    |
|             |         | 120           | 40               | -20000.00      | -3.481288       | 20          | PASS    |
| 11N40-SDM   | 5190    | 120           | 5                | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 10               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 30               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 40               | 0.00           | 0.000000        | 20          | PASS    |
|             | 5270    | 120           | 5                | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 10               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 30               | -40000.00      | -7.590133       | 20          | PASS    |
|             |         | 120           | 40               | -40000.00      | -7.590133       | 20          | PASS    |
|             | 5510    | 120           | 5                | -40000.00      | -7.259528       | 20          | PASS    |
|             |         | 120           | 10               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 30               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 40               | 0.00           | 0.000000        | 20          | PASS    |
|             | 5670    | 120           | 5                | -40000.00      | -7.054674       | 20          | PASS    |
|             |         | 120           | 10               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 30               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 40               | 0.00           | 0.000000        | 20          | PASS    |
|             | 5795    | 120           | 5                | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 10               | -40000.00      | -6.902502       | 20          | PASS    |
|             |         | 120           | 20               | -80000.00      | -13.805004      | 20          | PASS    |
|             |         | 120           | 30               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 40               | -40000.00      | -6.902502       | 20          | PASS    |
| 11AC80-SDM  | 5210    | 120           | 5                | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 10               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 20               | 80000.00       | 15.355086       | 20          | PASS    |
|             |         | 120           | 30               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 40               | 0.00           | 0.000000        | 20          | PASS    |
|             | 5290    | 120           | 5                | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 10               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 30               | 0.00           | 0.000000        | 20          | PASS    |
|             |         | 120           | 40               | 0.00           | 0.000000        | 20          | PASS    |

|             |      |     |    |           |            |    |      |
|-------------|------|-----|----|-----------|------------|----|------|
|             | 5530 | 120 | 5  | 0.00      | 0.000000   | 20 | PASS |
|             |      | 120 | 10 | 0.00      | 0.000000   | 20 | PASS |
|             |      | 120 | 20 | -80000.00 | -14.466546 | 20 | PASS |
|             |      | 120 | 30 | 0.00      | 0.000000   | 20 | PASS |
|             |      | 120 | 40 | 0.00      | 0.000000   | 20 | PASS |
|             | 5610 | 120 | 5  | -80000.00 | -14.260250 | 20 | PASS |
|             |      | 120 | 10 | -80000.00 | -14.260250 | 20 | PASS |
|             |      | 120 | 20 | -80000.00 | -14.260250 | 20 | PASS |
|             |      | 120 | 30 | -80000.00 | -14.260250 | 20 | PASS |
|             |      | 120 | 40 | -80000.00 | -14.260250 | 20 | PASS |
|             | 5775 | 120 | 5  | 0.00      | 0.000000   | 20 | PASS |
|             |      | 120 | 10 | 80000.00  | 13.852814  | 20 | PASS |
|             |      | 120 | 20 | 0.00      | 0.000000   | 20 | PASS |
|             |      | 120 | 30 | -80000.00 | -13.852814 | 20 | PASS |
|             |      | 120 | 40 | 0.00      | 0.000000   | 20 | PASS |
| 11AX160-SDM | 5250 | 120 | 5  | 0.00      | 0.000000   | 20 | PASS |
|             |      | 120 | 10 | 0.00      | 0.000000   | 20 | PASS |
|             |      | 120 | 20 | 0.00      | 0.000000   | 20 | PASS |
|             |      | 120 | 30 | 0.00      | 0.000000   | 20 | PASS |
|             |      | 120 | 40 | 0.00      | 0.000000   | 20 | PASS |
|             | 5570 | 120 | 5  | 0.00      | 0.000000   | 20 | PASS |
|             |      | 120 | 10 | 0.00      | 0.000000   | 20 | PASS |
|             |      | 120 | 20 | 0.00      | 0.000000   | 20 | PASS |
|             |      | 120 | 30 | 0.00      | 0.000000   | 20 | PASS |
|             |      | 120 | 40 | 0.00      | 0.000000   | 20 | PASS |

## 9. Duty Cycle

### 9.1. Test Result

| TestMode  | Antenna | Channel | Transmission Duration [ms] | Transmission Period [ms] | Duty Cycle [%] | 1/T VBW(KHz) | Verdict |
|-----------|---------|---------|----------------------------|--------------------------|----------------|--------------|---------|
| 11A       | Ant1    | 5180    | 0.13                       | 0.24                     | 54.17          | 7.69         | ---     |
|           | Ant2    | 5180    | 0.13                       | 0.24                     | 54.17          | 7.69         | ---     |
|           | Ant1    | 5200    | 0.13                       | 0.24                     | 54.17          | 7.69         | ---     |
|           | Ant2    | 5200    | 0.12                       | 0.23                     | 52.17          | 8.33         | ---     |
|           | Ant1    | 5240    | 0.13                       | 0.24                     | 54.17          | 7.69         | ---     |
|           | Ant2    | 5240    | 0.13                       | 0.24                     | 54.17          | 7.69         | ---     |
|           | Ant1    | 5260    | 0.13                       | 0.24                     | 54.17          | 7.69         | ---     |
|           | Ant2    | 5260    | 0.13                       | 0.23                     | 56.52          | 7.69         | ---     |
|           | Ant1    | 5280    | 0.13                       | 0.23                     | 56.52          | 7.69         | ---     |
|           | Ant2    | 5280    | 0.12                       | 0.23                     | 52.17          | 8.33         | ---     |
|           | Ant1    | 5320    | 0.13                       | 0.24                     | 54.17          | 7.69         | ---     |
|           | Ant2    | 5320    | 0.13                       | 0.24                     | 54.17          | 7.69         | ---     |
|           | Ant1    | 5500    | 0.13                       | 0.23                     | 56.52          | 7.69         | ---     |
|           | Ant2    | 5500    | 0.13                       | 0.24                     | 54.17          | 7.69         | ---     |
|           | Ant1    | 5580    | 0.12                       | 0.23                     | 52.17          | 8.33         | ---     |
|           | Ant2    | 5580    | 0.13                       | 0.24                     | 54.17          | 7.69         | ---     |
|           | Ant1    | 5700    | 0.12                       | 0.23                     | 52.17          | 8.33         | ---     |
|           | Ant2    | 5700    | 0.13                       | 0.23                     | 56.52          | 7.69         | ---     |
|           | Ant1    | 5720    | 0.13                       | 0.24                     | 54.17          | 7.69         | ---     |
|           | Ant2    | 5720    | 0.13                       | 0.24                     | 54.17          | 7.69         | ---     |
|           | Ant1    | 5745    | 0.12                       | 0.23                     | 52.17          | 8.33         | ---     |
|           | Ant2    | 5745    | 0.13                       | 0.24                     | 54.17          | 7.69         | ---     |
|           | Ant1    | 5785    | 0.12                       | 0.23                     | 52.17          | 8.33         | ---     |
|           | Ant2    | 5785    | 0.13                       | 0.23                     | 56.52          | 7.69         | ---     |
|           | Ant1    | 5825    | 0.13                       | 0.24                     | 54.17          | 7.69         | ---     |
|           | Ant2    | 5825    | 0.13                       | 0.24                     | 54.17          | 7.69         | ---     |
| 11N20-SDM | Ant1    | 5180    | 0.12                       | 0.22                     | 54.55          | 8.33         | ---     |
|           | Ant2    | 5180    | 0.12                       | 0.22                     | 54.55          | 8.33         | ---     |
|           | Ant1    | 5200    | 0.12                       | 0.22                     | 54.55          | 8.33         | ---     |
|           | Ant2    | 5200    | 0.12                       | 0.22                     | 54.55          | 8.33         | ---     |
|           | Ant1    | 5240    | 0.13                       | 0.23                     | 56.52          | 7.69         | ---     |
|           | Ant2    | 5240    | 0.12                       | 0.22                     | 54.55          | 8.33         | ---     |
|           | Ant1    | 5260    | 0.13                       | 0.23                     | 56.52          | 7.69         | ---     |
|           | Ant2    | 5260    | 0.12                       | 0.22                     | 54.55          | 8.33         | ---     |
|           | Ant1    | 5280    | 0.12                       | 0.22                     | 54.55          | 8.33         | ---     |
|           | Ant2    | 5280    | 0.13                       | 0.23                     | 56.52          | 7.69         | ---     |
|           | Ant1    | 5320    | 0.12                       | 0.22                     | 54.55          | 8.33         | ---     |
|           | Ant2    | 5320    | 0.13                       | 0.23                     | 56.52          | 7.69         | ---     |
|           | Ant1    | 5500    | 0.12                       | 0.22                     | 54.55          | 8.33         | ---     |
|           | Ant2    | 5500    | 0.13                       | 0.23                     | 56.52          | 7.69         | ---     |
|           | Ant1    | 5580    | 0.12                       | 0.22                     | 54.55          | 8.33         | ---     |
|           | Ant2    | 5580    | 0.13                       | 0.23                     | 56.52          | 7.69         | ---     |
|           | Ant1    | 5700    | 0.13                       | 0.23                     | 56.52          | 7.69         | ---     |
|           | Ant2    | 5700    | 0.13                       | 0.23                     | 56.52          | 7.69         | ---     |
|           | Ant1    | 5720    | 0.13                       | 0.23                     | 56.52          | 7.69         | ---     |
|           | Ant2    | 5720    | 0.12                       | 0.22                     | 54.55          | 8.33         | ---     |
|           | Ant1    | 5745    | 0.12                       | 0.22                     | 54.55          | 8.33         | ---     |
|           | Ant2    | 5745    | 0.12                       | 0.22                     | 54.55          | 8.33         | ---     |
|           | Ant1    | 5785    | 0.13                       | 0.23                     | 56.52          | 7.69         | ---     |
|           | Ant2    | 5785    | 0.13                       | 0.23                     | 56.52          | 7.69         | ---     |
|           | Ant1    | 5825    | 0.13                       | 0.23                     | 56.52          | 7.69         | ---     |
|           | Ant2    | 5825    | 0.12                       | 0.22                     | 54.55          | 8.33         | ---     |

|            |      |      |      |      |       |      |     |
|------------|------|------|------|------|-------|------|-----|
| 11N40-SDM  | Ant1 | 5190 | 0.12 | 0.22 | 54.55 | 8.33 | --- |
|            | Ant2 | 5190 | 0.11 | 0.21 | 52.38 | 9.09 | --- |
|            | Ant1 | 5230 | 0.12 | 0.22 | 54.55 | 8.33 | --- |
|            | Ant2 | 5230 | 0.12 | 0.22 | 54.55 | 8.33 | --- |
|            | Ant1 | 5270 | 0.12 | 0.22 | 54.55 | 8.33 | --- |
|            | Ant2 | 5270 | 0.12 | 0.22 | 54.55 | 8.33 | --- |
|            | Ant1 | 5310 | 0.12 | 0.22 | 54.55 | 8.33 | --- |
|            | Ant2 | 5310 | 0.11 | 0.21 | 52.38 | 9.09 | --- |
|            | Ant1 | 5510 | 0.11 | 0.21 | 52.38 | 9.09 | --- |
|            | Ant2 | 5510 | 0.12 | 0.22 | 54.55 | 8.33 | --- |
|            | Ant1 | 5550 | 0.12 | 0.22 | 54.55 | 8.33 | --- |
|            | Ant2 | 5550 | 0.11 | 0.21 | 52.38 | 9.09 | --- |
|            | Ant1 | 5670 | 0.12 | 0.22 | 54.55 | 8.33 | --- |
|            | Ant2 | 5670 | 0.12 | 0.22 | 54.55 | 8.33 | --- |
|            | Ant1 | 5710 | 0.12 | 0.22 | 54.55 | 8.33 | --- |
|            | Ant2 | 5710 | 0.12 | 0.22 | 54.55 | 8.33 | --- |
|            | Ant1 | 5755 | 0.12 | 0.22 | 54.55 | 8.33 | --- |
|            | Ant2 | 5755 | 0.12 | 0.22 | 54.55 | 8.33 | --- |
|            | Ant1 | 5795 | 0.12 | 0.22 | 54.55 | 8.33 | --- |
|            | Ant2 | 5795 | 0.11 | 0.21 | 52.38 | 9.09 | --- |
| 11AC20-SDM | Ant1 | 5180 | 0.14 | 0.17 | 82.35 | 7.14 | --- |
|            | Ant2 | 5180 | 0.14 | 0.17 | 82.35 | 7.14 | --- |
|            | Ant1 | 5200 | 0.13 | 0.16 | 81.25 | 7.69 | --- |
|            | Ant2 | 5200 | 0.14 | 0.17 | 82.35 | 7.14 | --- |
|            | Ant1 | 5240 | 0.13 | 0.16 | 81.25 | 7.69 | --- |
|            | Ant2 | 5240 | 0.13 | 0.16 | 81.25 | 7.69 | --- |
|            | Ant1 | 5260 | 0.13 | 0.16 | 81.25 | 7.69 | --- |
|            | Ant2 | 5260 | 0.13 | 0.16 | 81.25 | 7.69 | --- |
|            | Ant1 | 5280 | 0.13 | 0.16 | 81.25 | 7.69 | --- |
|            | Ant2 | 5280 | 0.13 | 0.16 | 81.25 | 7.69 | --- |
|            | Ant1 | 5320 | 0.14 | 0.17 | 82.35 | 7.14 | --- |
|            | Ant2 | 5320 | 0.13 | 0.16 | 81.25 | 7.69 | --- |
|            | Ant1 | 5500 | 0.14 | 0.17 | 82.35 | 7.14 | --- |
|            | Ant2 | 5500 | 0.14 | 0.17 | 82.35 | 7.14 | --- |
|            | Ant1 | 5580 | 0.13 | 0.16 | 81.25 | 7.69 | --- |
|            | Ant2 | 5580 | 0.14 | 0.17 | 82.35 | 7.14 | --- |
|            | Ant1 | 5700 | 0.14 | 0.17 | 82.35 | 7.14 | --- |
|            | Ant2 | 5700 | 0.14 | 0.17 | 82.35 | 7.14 | --- |
|            | Ant1 | 5720 | 0.13 | 0.16 | 81.25 | 7.69 | --- |
|            | Ant2 | 5720 | 0.13 | 0.16 | 81.25 | 7.69 | --- |
|            | Ant1 | 5745 | 0.14 | 0.17 | 82.35 | 7.14 | --- |
|            | Ant2 | 5745 | 0.14 | 0.17 | 82.35 | 7.14 | --- |
|            | Ant1 | 5785 | 0.14 | 0.17 | 82.35 | 7.14 | --- |
|            | Ant2 | 5785 | 0.13 | 0.16 | 81.25 | 7.69 | --- |
|            | Ant1 | 5825 | 0.13 | 0.16 | 81.25 | 7.69 | --- |
|            | Ant2 | 5825 | 0.14 | 0.17 | 82.35 | 7.14 | --- |
| 11AC40-SDM | Ant1 | 5190 | 0.13 | 0.16 | 81.25 | 7.69 | --- |
|            | Ant2 | 5190 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|            | Ant1 | 5230 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|            | Ant2 | 5230 | 0.13 | 0.16 | 81.25 | 7.69 | --- |
|            | Ant1 | 5270 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|            | Ant2 | 5270 | 0.13 | 0.16 | 81.25 | 7.69 | --- |
|            | Ant1 | 5310 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|            | Ant2 | 5310 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|            | Ant1 | 5510 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|            | Ant2 | 5510 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|            | Ant1 | 5550 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|            | Ant2 | 5550 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|            | Ant1 | 5670 | 0.12 | 0.15 | 80.00 | 8.33 | --- |

|             |      |      |      |      |       |      |     |
|-------------|------|------|------|------|-------|------|-----|
|             | Ant2 | 5670 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|             | Ant1 | 5710 | 0.13 | 0.16 | 81.25 | 7.69 | --- |
|             | Ant2 | 5710 | 0.13 | 0.16 | 81.25 | 7.69 | --- |
|             | Ant1 | 5755 | 0.13 | 0.16 | 81.25 | 7.69 | --- |
|             | Ant2 | 5755 | 0.13 | 0.16 | 81.25 | 7.69 | --- |
|             | Ant1 | 5795 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|             | Ant2 | 5795 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
| 11AC80-SDM  | Ant1 | 5210 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|             | Ant2 | 5210 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|             | Ant1 | 5290 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|             | Ant2 | 5290 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|             | Ant1 | 5530 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|             | Ant2 | 5530 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|             | Ant1 | 5610 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|             | Ant2 | 5610 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|             | Ant1 | 5690 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|             | Ant2 | 5690 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|             | Ant1 | 5775 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|             | Ant2 | 5775 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
| 11AC160-SDM | Ant1 | 5250 | 0.11 | 0.14 | 78.57 | 9.09 | --- |
|             | Ant2 | 5250 | 0.11 | 0.14 | 78.57 | 9.09 | --- |
|             | Ant1 | 5570 | 0.12 | 0.15 | 80.00 | 8.33 | --- |
|             | Ant2 | 5570 | 0.11 | 0.14 | 78.57 | 9.09 | --- |
| 11AX20-SDM  | Ant1 | 5180 | 0.31 | 0.34 | 91.18 | 3.23 | --- |
|             | Ant2 | 5180 | 0.31 | 0.34 | 91.18 | 3.23 | --- |
|             | Ant1 | 5200 | 0.32 | 0.35 | 91.43 | 3.13 | --- |
|             | Ant2 | 5200 | 0.32 | 0.35 | 91.43 | 3.13 | --- |
|             | Ant1 | 5240 | 0.31 | 0.34 | 91.18 | 3.23 | --- |
|             | Ant2 | 5240 | 0.31 | 0.34 | 91.18 | 3.23 | --- |
|             | Ant1 | 5260 | 0.31 | 0.34 | 91.18 | 3.23 | --- |
|             | Ant2 | 5260 | 0.31 | 0.34 | 91.18 | 3.23 | --- |
|             | Ant1 | 5280 | 0.32 | 0.35 | 91.43 | 3.13 | --- |
|             | Ant2 | 5280 | 0.31 | 0.34 | 91.18 | 3.23 | --- |
|             | Ant1 | 5320 | 0.32 | 0.35 | 91.43 | 3.13 | --- |
|             | Ant2 | 5320 | 0.32 | 0.35 | 91.43 | 3.13 | --- |
|             | Ant1 | 5500 | 0.32 | 0.35 | 91.43 | 3.13 | --- |
|             | Ant2 | 5500 | 0.32 | 0.35 | 91.43 | 3.13 | --- |
|             | Ant1 | 5580 | 0.31 | 0.34 | 91.18 | 3.23 | --- |
|             | Ant2 | 5580 | 0.32 | 0.35 | 91.43 | 3.13 | --- |
|             | Ant1 | 5700 | 0.32 | 0.35 | 91.43 | 3.13 | --- |
|             | Ant2 | 5700 | 0.32 | 0.35 | 91.43 | 3.13 | --- |
|             | Ant1 | 5720 | 0.31 | 0.34 | 91.18 | 3.23 | --- |
|             | Ant2 | 5720 | 0.31 | 0.34 | 91.18 | 3.23 | --- |
|             | Ant1 | 5745 | 0.32 | 0.35 | 91.43 | 3.13 | --- |
|             | Ant2 | 5745 | 0.32 | 0.35 | 91.43 | 3.13 | --- |
|             | Ant1 | 5785 | 0.31 | 0.34 | 91.18 | 3.23 | --- |
|             | Ant2 | 5785 | 0.31 | 0.34 | 91.18 | 3.23 | --- |
|             | Ant1 | 5825 | 0.31 | 0.34 | 91.18 | 3.23 | --- |
|             | Ant2 | 5825 | 0.31 | 0.34 | 91.18 | 3.23 | --- |
| 11AX40-SDM  | Ant1 | 5190 | 0.31 | 0.34 | 91.18 | 3.23 | --- |
|             | Ant2 | 5190 | 0.30 | 0.33 | 90.91 | 3.33 | --- |
|             | Ant1 | 5230 | 0.30 | 0.33 | 90.91 | 3.33 | --- |
|             | Ant2 | 5230 | 0.30 | 0.33 | 90.91 | 3.33 | --- |
|             | Ant1 | 5270 | 0.30 | 0.34 | 88.24 | 3.33 | --- |
|             | Ant2 | 5270 | 0.31 | 0.34 | 91.18 | 3.23 | --- |
|             | Ant1 | 5310 | 0.30 | 0.34 | 88.24 | 3.33 | --- |
|             | Ant2 | 5310 | 0.30 | 0.33 | 90.91 | 3.33 | --- |
|             | Ant1 | 5510 | 0.30 | 0.33 | 90.91 | 3.33 | --- |
|             | Ant2 | 5510 | 0.30 | 0.33 | 90.91 | 3.33 | --- |

|             |      |      |      |      |       |      |     |
|-------------|------|------|------|------|-------|------|-----|
|             | Ant1 | 5550 | 0.30 | 0.34 | 88.24 | 3.33 | --- |
|             | Ant2 | 5550 | 0.30 | 0.34 | 88.24 | 3.33 | --- |
|             | Ant1 | 5670 | 0.30 | 0.34 | 88.24 | 3.33 | --- |
|             | Ant2 | 5670 | 0.30 | 0.33 | 90.91 | 3.33 | --- |
|             | Ant1 | 5710 | 0.31 | 0.34 | 91.18 | 3.23 | --- |
|             | Ant2 | 5710 | 0.30 | 0.33 | 90.91 | 3.33 | --- |
|             | Ant1 | 5755 | 0.30 | 0.33 | 90.91 | 3.33 | --- |
|             | Ant2 | 5755 | 0.30 | 0.33 | 90.91 | 3.33 | --- |
|             | Ant1 | 5795 | 0.31 | 0.34 | 91.18 | 3.23 | --- |
|             | Ant2 | 5795 | 0.30 | 0.33 | 90.91 | 3.33 | --- |
| 11AX80-SDM  | Ant1 | 5210 | 0.30 | 0.33 | 90.91 | 3.33 | --- |
|             | Ant2 | 5210 | 0.29 | 0.32 | 90.63 | 3.45 | --- |
|             | Ant1 | 5290 | 0.29 | 0.32 | 90.63 | 3.45 | --- |
|             | Ant2 | 5290 | 0.29 | 0.32 | 90.63 | 3.45 | --- |
|             | Ant1 | 5530 | 0.30 | 0.33 | 90.91 | 3.33 | --- |
|             | Ant2 | 5530 | 0.29 | 0.32 | 90.63 | 3.45 | --- |
|             | Ant1 | 5610 | 0.29 | 0.32 | 90.63 | 3.45 | --- |
|             | Ant2 | 5610 | 0.29 | 0.33 | 87.88 | 3.45 | --- |
|             | Ant1 | 5690 | 0.29 | 0.32 | 90.63 | 3.45 | --- |
|             | Ant2 | 5690 | 0.29 | 0.32 | 90.63 | 3.45 | --- |
|             | Ant1 | 5775 | 0.29 | 0.32 | 90.63 | 3.45 | --- |
|             | Ant2 | 5775 | 0.29 | 0.32 | 90.63 | 3.45 | --- |
| 11AX160-SDM | Ant1 | 5250 | 0.29 | 0.33 | 87.88 | 3.45 | --- |
|             | Ant2 | 5250 | 0.29 | 0.33 | 87.88 | 3.45 | --- |
|             | Ant1 | 5570 | 0.30 | 0.33 | 90.91 | 3.33 | --- |
|             | Ant2 | 5570 | 0.29 | 0.33 | 87.88 | 3.45 | --- |

| TestMode  | Antenna | Channel | Transmission Duration [ms] | Transmission Period [ms] | Duty Cycle [%] | 1/T VBW(KHz) | Verdict |
|-----------|---------|---------|----------------------------|--------------------------|----------------|--------------|---------|
| 11N20-BF  | Ant1    | 5180    | 3.89                       | 4.07                     | 95.58          | 0.26         |         |
|           | Ant2    | 5180    | 3.84                       | 3.94                     | 97.46          | 0.26         |         |
|           | Ant1    | 5200    | 3.89                       | 4.07                     | 95.58          | 0.26         |         |
|           | Ant2    | 5200    | 3.89                       | 4.07                     | 95.58          | 0.26         |         |
|           | Ant1    | 5240    | 3.84                       | 3.98                     | 96.48          | 0.26         |         |
|           | Ant2    | 5240    | 3.84                       | 3.99                     | 96.24          | 0.26         |         |
|           | Ant1    | 5260    | 3.84                       | 3.94                     | 97.46          | 0.26         |         |
|           | Ant2    | 5260    | 3.85                       | 3.98                     | 96.73          | 0.26         |         |
|           | Ant1    | 5280    | 3.84                       | 3.94                     | 97.46          | 0.26         |         |
|           | Ant2    | 5280    | 0.55                       | 0.70                     | 78.57          | 1.82         |         |
|           | Ant1    | 5320    | 3.89                       | 4.08                     | 95.34          | 0.26         |         |
|           | Ant2    | 5320    | 3.84                       | 3.97                     | 96.73          | 0.26         |         |
|           | Ant1    | 5500    | 3.84                       | 4.02                     | 95.52          | 0.26         |         |
|           | Ant2    | 5500    | 3.89                       | 4.07                     | 95.58          | 0.26         |         |
|           | Ant1    | 5580    | 3.84                       | 3.94                     | 97.46          | 0.26         |         |
|           | Ant2    | 5580    | 3.84                       | 3.94                     | 97.46          | 0.26         |         |
|           | Ant1    | 5700    | 3.89                       | 4.08                     | 95.34          | 0.26         |         |
|           | Ant2    | 5700    | 3.84                       | 4.82                     | 79.67          | 0.26         |         |
|           | Ant1    | 5720    | 3.89                       | 4.07                     | 95.58          | 0.26         |         |
|           | Ant2    | 5720    | 3.84                       | 4.09                     | 93.89          | 0.26         |         |
|           | Ant1    | 5745    | 3.84                       | 3.95                     | 97.22          | 0.26         |         |
|           | Ant2    | 5745    | 3.84                       | 4.05                     | 94.81          | 0.26         |         |
|           | Ant1    | 5785    | 3.84                       | 3.95                     | 97.22          | 0.26         |         |
|           | Ant2    | 5785    | 3.89                       | 4.06                     | 95.81          | 0.26         |         |
|           | Ant1    | 5825    | 3.84                       | 4.02                     | 95.52          | 0.26         |         |
|           | Ant2    | 5825    | 3.84                       | 3.94                     | 97.46          | 0.26         |         |
| 11N40-BF  | Ant1    | 5190    | 4.66                       | 4.84                     | 96.28          | 0.21         |         |
|           | Ant2    | 5190    | 4.66                       | 4.84                     | 96.28          | 0.21         |         |
|           | Ant1    | 5230    | 4.61                       | 4.87                     | 94.66          | 0.22         |         |
|           | Ant2    | 5230    | 4.61                       | 5.37                     | 85.85          | 0.22         |         |
|           | Ant1    | 5270    | 4.66                       | 4.84                     | 96.28          | 0.21         |         |
|           | Ant2    | 5270    | 4.66                       | 4.84                     | 96.28          | 0.21         |         |
|           | Ant1    | 5310    | 4.66                       | 4.84                     | 96.28          | 0.21         |         |
|           | Ant2    | 5310    | 0.56                       | 0.59                     | 94.92          | 1.79         |         |
|           | Ant1    | 5510    | 4.61                       | 4.78                     | 96.44          | 0.22         |         |
|           | Ant2    | 5510    | 0.56                       | 0.59                     | 94.92          | 1.79         |         |
|           | Ant1    | 5550    | 4.61                       | 4.86                     | 94.86          | 0.22         |         |
|           | Ant2    | 5550    | 4.61                       | 4.85                     | 95.05          | 0.22         |         |
|           | Ant1    | 5670    | 0.99                       | 1.03                     | 96.12          | 1.01         |         |
|           | Ant2    | 5670    | 4.66                       | 4.84                     | 96.28          | 0.21         |         |
|           | Ant1    | 5710    | 3.69                       | 3.91                     | 94.37          | 0.27         |         |
|           | Ant2    | 5710    | 3.69                       | 3.80                     | 97.11          | 0.27         |         |
|           | Ant1    | 5755    | 1.87                       | 1.97                     | 94.92          | 0.53         |         |
|           | Ant2    | 5755    | 1.87                       | 1.97                     | 94.92          | 0.53         |         |
|           | Ant1    | 5795    | 5.36                       | 5.50                     | 97.45          | 0.19         |         |
|           | Ant2    | 5795    | 5.31                       | 5.39                     | 98.52          | 0.19         |         |
| 11AC20-BF | Ant1    | 5180    | 3.83                       | 3.94                     | 97.21          | 0.26         |         |
|           | Ant2    | 5180    | 3.83                       | 3.93                     | 97.46          | 0.26         |         |
|           | Ant1    | 5200    | 3.84                       | 4.85                     | 79.18          | 0.26         |         |
|           | Ant2    | 5200    | 3.83                       | 3.94                     | 97.21          | 0.26         |         |
|           | Ant1    | 5240    | 3.84                       | 3.94                     | 97.46          | 0.26         |         |
|           | Ant2    | 5240    | 3.84                       | 3.94                     | 97.46          | 0.26         |         |
|           | Ant1    | 5260    | 3.83                       | 4.79                     | 79.96          | 0.26         |         |
|           | Ant2    | 5260    | 3.84                       | 3.94                     | 97.46          | 0.26         |         |
|           | Ant1    | 5280    | 3.84                       | 4.03                     | 95.29          | 0.26         |         |
|           | Ant2    | 5280    | 3.89                       | 4.07                     | 95.58          | 0.26         |         |


|            |      |      |      |      |       |      |  |
|------------|------|------|------|------|-------|------|--|
|            | Ant1 | 5320 | 3.83 | 3.94 | 97.21 | 0.26 |  |
|            | Ant2 | 5320 | 3.84 | 4.01 | 95.76 | 0.26 |  |
|            | Ant1 | 5500 | 3.89 | 4.06 | 95.81 | 0.26 |  |
|            | Ant2 | 5500 | 3.84 | 3.94 | 97.46 | 0.26 |  |
|            | Ant1 | 5580 | 3.89 | 4.07 | 95.58 | 0.26 |  |
|            | Ant2 | 5580 | 3.84 | 3.94 | 97.46 | 0.26 |  |
|            | Ant1 | 5700 | 3.84 | 3.94 | 97.46 | 0.26 |  |
|            | Ant2 | 5700 | 3.83 | 3.94 | 97.21 | 0.26 |  |
|            | Ant1 | 5720 | 3.84 | 3.94 | 97.46 | 0.26 |  |
|            | Ant2 | 5720 | 3.84 | 4.05 | 94.81 | 0.26 |  |
|            | Ant1 | 5745 | 3.89 | 4.07 | 95.58 | 0.26 |  |
|            | Ant2 | 5745 | 3.84 | 4.05 | 94.81 | 0.26 |  |
|            | Ant1 | 5785 | 3.84 | 3.94 | 97.46 | 0.26 |  |
|            | Ant2 | 5785 | 3.84 | 3.94 | 97.46 | 0.26 |  |
|            | Ant1 | 5825 | 3.84 | 4.01 | 95.76 | 0.26 |  |
|            | Ant2 | 5825 | 3.84 | 3.94 | 97.46 | 0.26 |  |
| 11AC40-BF  | Ant1 | 5190 | 3.69 | 3.81 | 96.85 | 0.27 |  |
|            | Ant2 | 5190 | 3.69 | 3.83 | 96.34 | 0.27 |  |
|            | Ant1 | 5230 | 4.67 | 4.84 | 96.49 | 0.21 |  |
|            | Ant2 | 5230 | 4.66 | 4.84 | 96.28 | 0.21 |  |
|            | Ant1 | 5270 | 3.74 | 3.94 | 94.92 | 0.27 |  |
|            | Ant2 | 5270 | 3.69 | 3.79 | 97.36 | 0.27 |  |
|            | Ant1 | 5310 | 3.69 | 4.32 | 85.42 | 0.27 |  |
|            | Ant2 | 5310 | 3.69 | 3.86 | 95.60 | 0.27 |  |
|            | Ant1 | 5510 | 3.69 | 3.80 | 97.11 | 0.27 |  |
|            | Ant2 | 5510 | 3.69 | 3.93 | 93.89 | 0.27 |  |
|            | Ant1 | 5550 | 3.70 | 3.80 | 97.37 | 0.27 |  |
|            | Ant2 | 5550 | 3.69 | 3.80 | 97.11 | 0.27 |  |
|            | Ant1 | 5670 | 3.69 | 3.86 | 95.60 | 0.27 |  |
|            | Ant2 | 5670 | 3.69 | 3.81 | 96.85 | 0.27 |  |
|            | Ant1 | 5710 | 1.87 | 1.97 | 94.92 | 0.53 |  |
|            | Ant2 | 5710 | 1.87 | 1.97 | 94.92 | 0.53 |  |
| 11AC80-BF  | Ant1 | 5755 | 1.87 | 1.97 | 94.92 | 0.53 |  |
|            | Ant2 | 5755 | 4.61 | 4.71 | 97.88 | 0.22 |  |
|            | Ant1 | 5795 | 3.69 | 3.82 | 96.60 | 0.27 |  |
|            | Ant2 | 5795 | 3.69 | 3.79 | 97.36 | 0.27 |  |
|            | Ant1 | 5210 | 0.56 | 0.64 | 87.50 | 1.79 |  |
|            | Ant2 | 5210 | 5.39 | 5.52 | 97.64 | 0.19 |  |
|            | Ant1 | 5290 | 5.41 | 5.56 | 97.30 | 0.18 |  |
|            | Ant2 | 5290 | 5.28 | 5.43 | 97.24 | 0.19 |  |
|            | Ant1 | 5530 | 5.07 | 5.29 | 95.84 | 0.20 |  |
|            | Ant2 | 5530 | 5.07 | 5.25 | 96.57 | 0.20 |  |
|            | Ant1 | 5610 | 5.12 | 5.30 | 96.60 | 0.20 |  |
|            | Ant2 | 5610 | 5.19 | 5.53 | 93.85 | 0.19 |  |
| 11AC160-BF | Ant1 | 5690 | 0.56 | 0.62 | 90.32 | 1.79 |  |
|            | Ant2 | 5690 | 5.12 | 5.30 | 96.60 | 0.20 |  |
|            | Ant1 | 5775 | 5.12 | 5.30 | 96.60 | 0.20 |  |
|            | Ant2 | 5775 | 5.07 | 5.55 | 91.35 | 0.20 |  |
| 11AX20-BF  | Ant1 | 5250 | 5.28 | 5.45 | 96.88 | 0.19 |  |
|            | Ant2 | 5250 | 5.28 | 5.52 | 95.65 | 0.19 |  |
|            | Ant1 | 5570 | 5.33 | 5.51 | 96.73 | 0.19 |  |
|            | Ant2 | 5570 | 5.28 | 5.52 | 95.65 | 0.19 |  |
|            | Ant1 | 5180 | 2.98 | 3.16 | 94.30 | 0.34 |  |
|            | Ant2 | 5180 | 2.93 | 3.03 | 96.70 | 0.34 |  |
|            | Ant1 | 5200 | 2.93 | 3.03 | 96.70 | 0.34 |  |
|            | Ant2 | 5200 | 2.93 | 3.10 | 94.52 | 0.34 |  |
|            | Ant1 | 5240 | 2.93 | 3.11 | 94.21 | 0.34 |  |
|            | Ant2 | 5240 | 2.98 | 3.16 | 94.30 | 0.34 |  |
|            | Ant1 | 5260 | 0.55 | 0.60 | 91.67 | 1.82 |  |

|            |      |      |      |      |       |      |  |
|------------|------|------|------|------|-------|------|--|
|            | Ant2 | 5260 | 5.40 | 5.53 | 97.65 | 0.19 |  |
|            | Ant1 | 5280 | 2.98 | 3.15 | 94.60 | 0.34 |  |
|            | Ant2 | 5280 | 2.93 | 3.25 | 90.15 | 0.34 |  |
|            | Ant1 | 5320 | 2.93 | 3.03 | 96.70 | 0.34 |  |
|            | Ant2 | 5320 | 3.05 | 3.38 | 90.24 | 0.33 |  |
|            | Ant1 | 5500 | 2.92 | 3.31 | 88.22 | 0.34 |  |
|            | Ant2 | 5500 | 2.93 | 3.02 | 97.02 | 0.34 |  |
|            | Ant1 | 5580 | 5.23 | 5.35 | 97.76 | 0.19 |  |
|            | Ant2 | 5580 | 5.43 | 5.55 | 97.84 | 0.18 |  |
|            | Ant1 | 5700 | 2.83 | 3.01 | 94.02 | 0.35 |  |
|            | Ant2 | 5700 | 2.93 | 3.13 | 93.61 | 0.34 |  |
|            | Ant1 | 5720 | 2.98 | 3.16 | 94.30 | 0.34 |  |
|            | Ant2 | 5720 | 2.93 | 3.34 | 87.72 | 0.34 |  |
|            | Ant1 | 5745 | 2.98 | 3.16 | 94.30 | 0.34 |  |
|            | Ant2 | 5745 | 2.98 | 3.15 | 94.60 | 0.34 |  |
|            | Ant1 | 5785 | 5.31 | 5.40 | 98.33 | 0.19 |  |
|            | Ant2 | 5785 | 0.55 | 0.64 | 85.94 | 1.82 |  |
|            | Ant1 | 5825 | 2.98 | 3.16 | 94.30 | 0.34 |  |
|            | Ant2 | 5825 | 2.82 | 3.00 | 94.00 | 0.35 |  |
| 11AX40-BF  | Ant1 | 5190 | 4.36 | 4.47 | 97.54 | 0.23 |  |
|            | Ant2 | 5190 | 4.41 | 4.58 | 96.29 | 0.23 |  |
|            | Ant1 | 5230 | 4.48 | 4.82 | 92.95 | 0.22 |  |
|            | Ant2 | 5230 | 4.48 | 4.77 | 93.92 | 0.22 |  |
|            | Ant1 | 5270 | 2.98 | 3.15 | 94.60 | 0.34 |  |
|            | Ant2 | 5270 | 2.98 | 3.15 | 94.60 | 0.34 |  |
|            | Ant1 | 5310 | 4.41 | 4.59 | 96.08 | 0.23 |  |
|            | Ant2 | 5310 | 4.48 | 4.79 | 93.53 | 0.22 |  |
|            | Ant1 | 5510 | 4.48 | 4.78 | 93.72 | 0.22 |  |
|            | Ant2 | 5510 | 4.36 | 4.69 | 92.96 | 0.23 |  |
|            | Ant1 | 5550 | 4.40 | 4.74 | 92.83 | 0.23 |  |
|            | Ant2 | 5550 | 4.41 | 4.58 | 96.29 | 0.23 |  |
|            | Ant1 | 5670 | 4.36 | 4.54 | 96.04 | 0.23 |  |
|            | Ant2 | 5670 | 4.33 | 4.51 | 96.01 | 0.23 |  |
|            | Ant1 | 5710 | 4.36 | 4.63 | 94.17 | 0.23 |  |
|            | Ant2 | 5710 | 4.41 | 4.59 | 96.08 | 0.23 |  |
|            | Ant1 | 5755 | 4.36 | 4.60 | 94.78 | 0.23 |  |
|            | Ant2 | 5755 | 4.41 | 4.59 | 96.08 | 0.23 |  |
|            | Ant1 | 5795 | 0.62 | 0.70 | 88.57 | 1.61 |  |
|            | Ant2 | 5795 | 4.41 | 4.59 | 96.08 | 0.23 |  |
| 11AX80-BF  | Ant1 | 5210 | 4.14 | 4.27 | 96.96 | 0.24 |  |
|            | Ant2 | 5210 | 4.14 | 4.43 | 93.45 | 0.24 |  |
|            | Ant1 | 5290 | 4.16 | 4.34 | 95.85 | 0.24 |  |
|            | Ant2 | 5290 | 4.26 | 4.57 | 93.22 | 0.23 |  |
|            | Ant1 | 5530 | 5.18 | 5.43 | 95.40 | 0.19 |  |
|            | Ant2 | 5530 | 4.19 | 4.37 | 95.88 | 0.24 |  |
|            | Ant1 | 5610 | 4.14 | 4.41 | 93.88 | 0.24 |  |
|            | Ant2 | 5610 | 0.62 | 0.75 | 82.67 | 1.61 |  |
|            | Ant1 | 5690 | 4.26 | 4.56 | 93.42 | 0.23 |  |
|            | Ant2 | 5690 | 4.19 | 4.48 | 93.53 | 0.24 |  |
|            | Ant1 | 5775 | 4.16 | 4.34 | 95.85 | 0.24 |  |
|            | Ant2 | 5775 | 4.19 | 4.37 | 95.88 | 0.24 |  |
| 11AX160-BF | Ant1 | 5250 | 4.87 | 5.31 | 91.71 | 0.21 |  |
|            | Ant2 | 5250 | 4.87 | 5.86 | 83.11 | 0.21 |  |
|            | Ant1 | 5570 | 5.16 | 5.35 | 96.45 | 0.19 |  |
|            | Ant2 | 5570 | 5.16 | 5.42 | 95.20 | 0.19 |  |


## 9.2. Test Graphs




### 11A\_Ant2\_5200

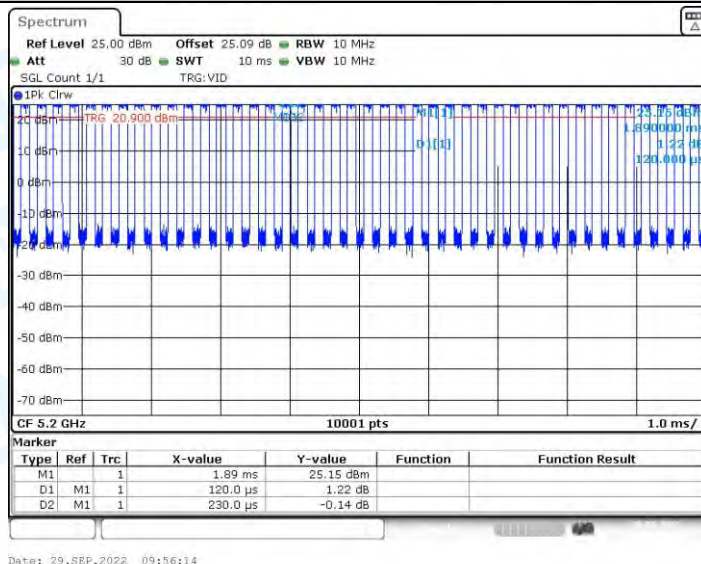


### 11A\_Ant1\_5240

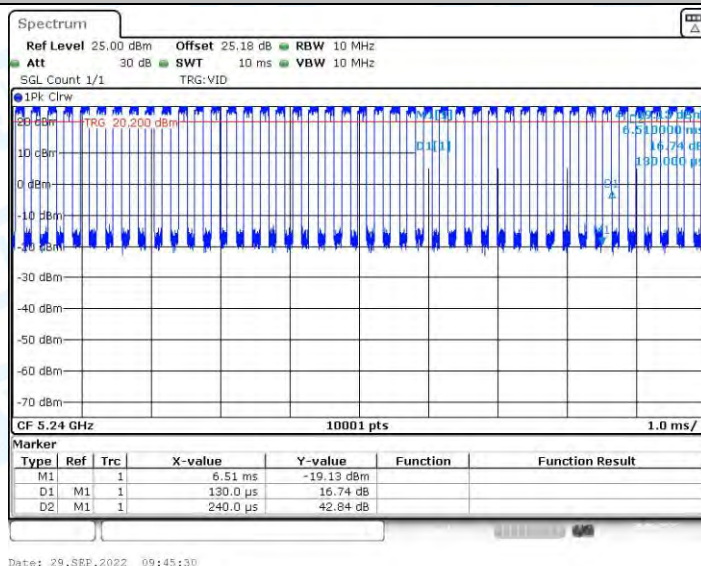


### 11A\_Ant2\_5240

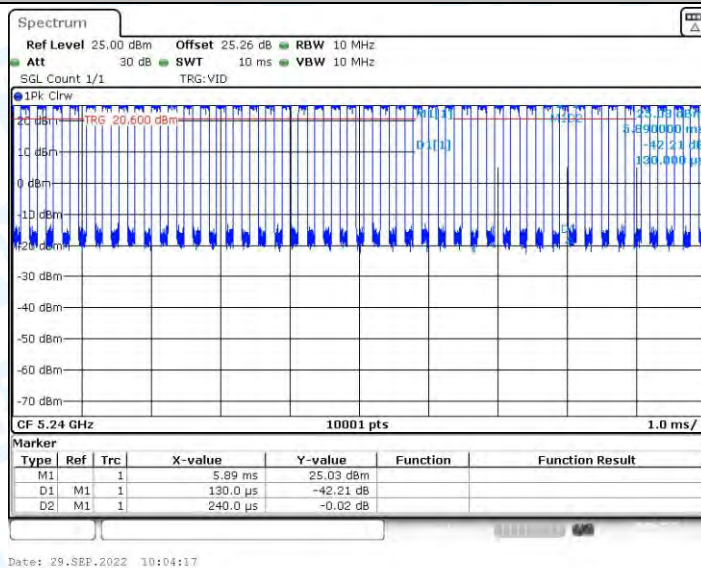


### 11A\_Ant1\_5260

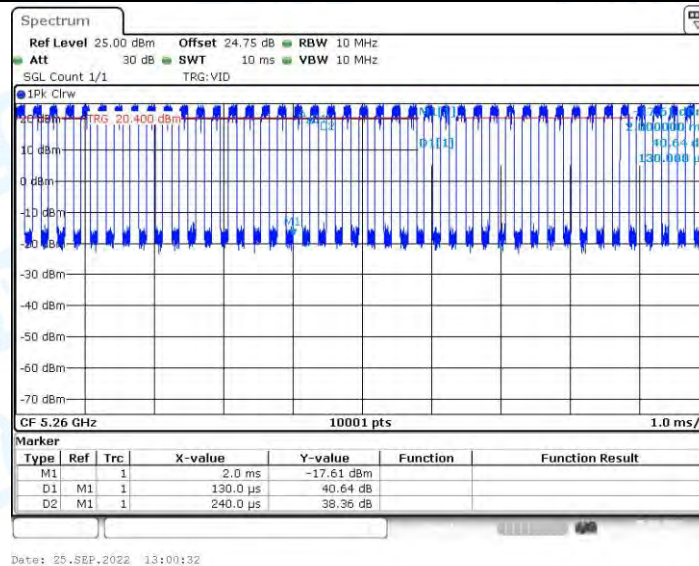


### 11A\_Ant2\_5260

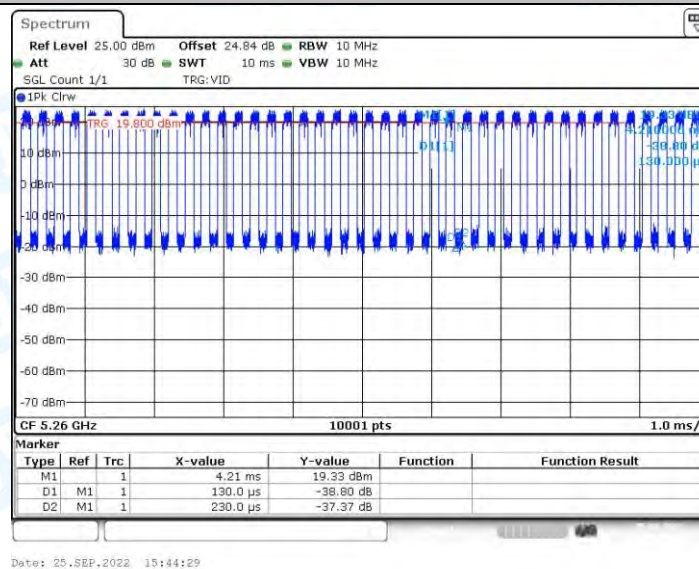


### 11A\_Ant1\_5280

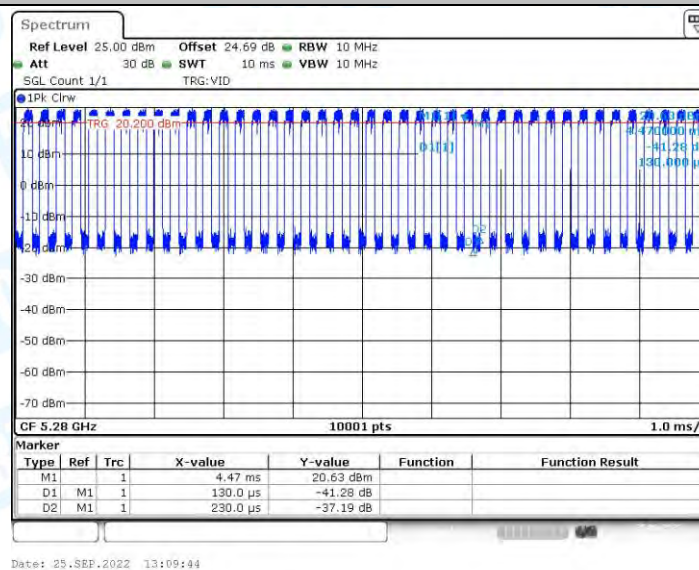


### 11A\_Ant2\_5280

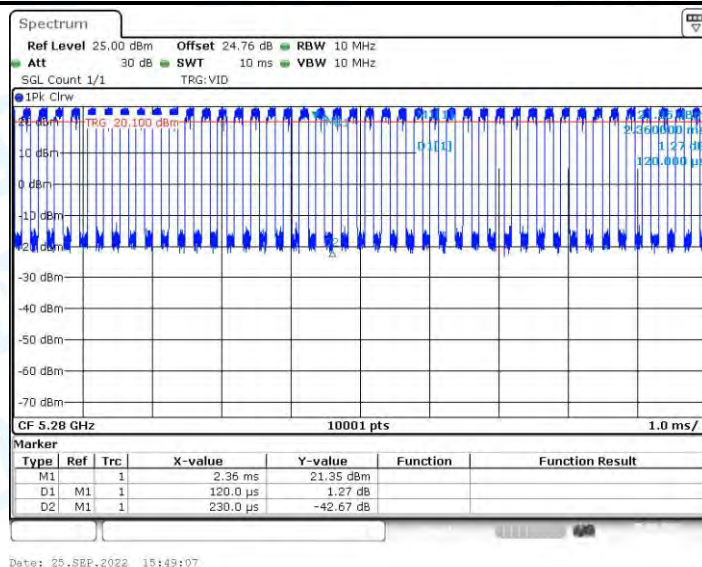


11A\_Ant1\_5320

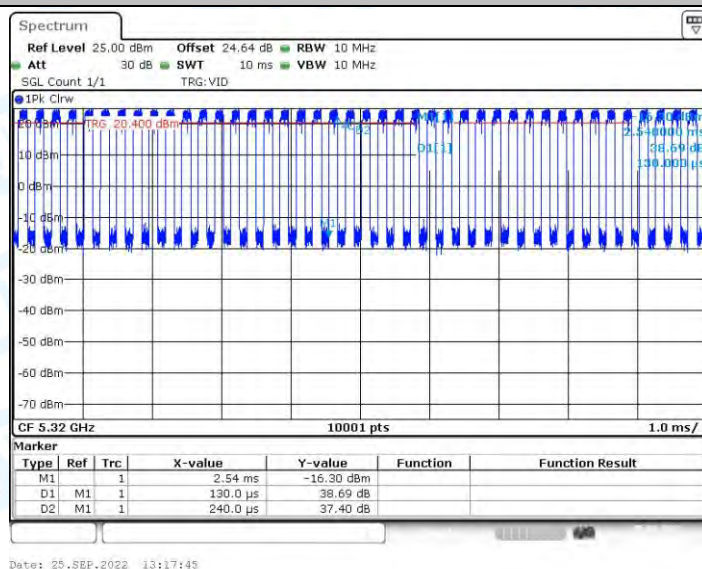


11A\_Ant2\_5320

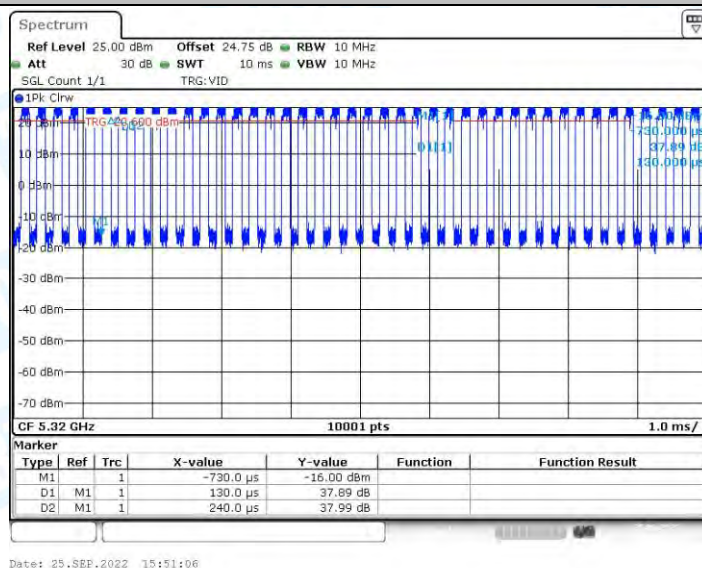


11A\_Ant1\_5500

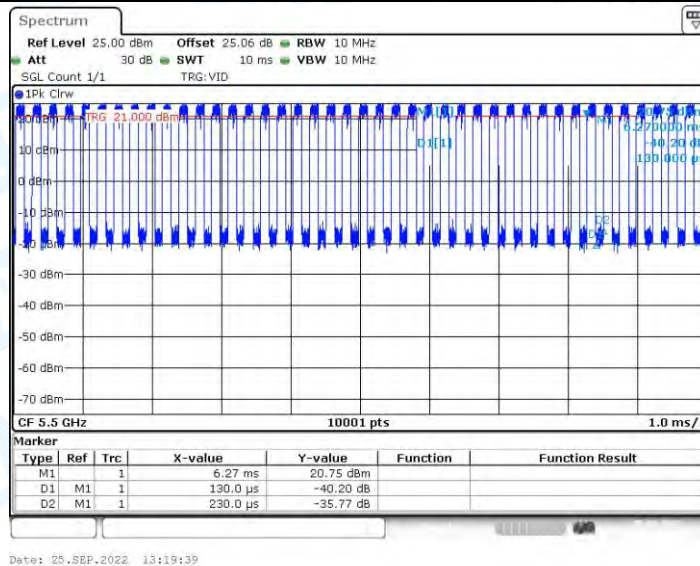


11A\_Ant2\_5500

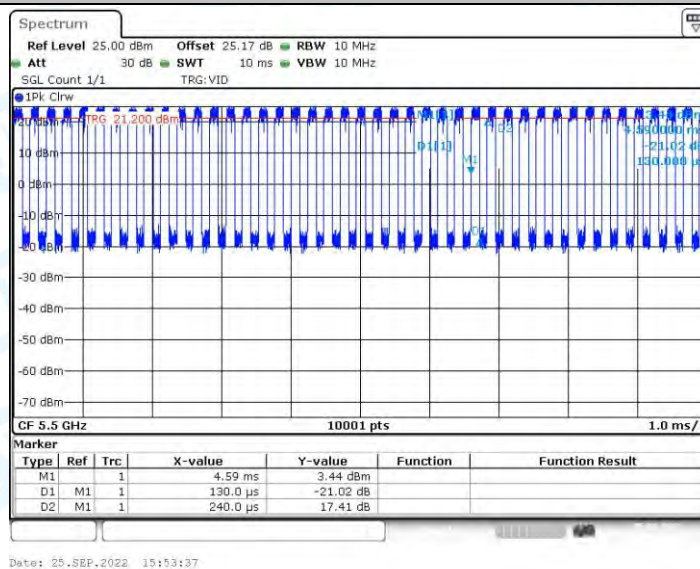


11A\_Ant1\_5580

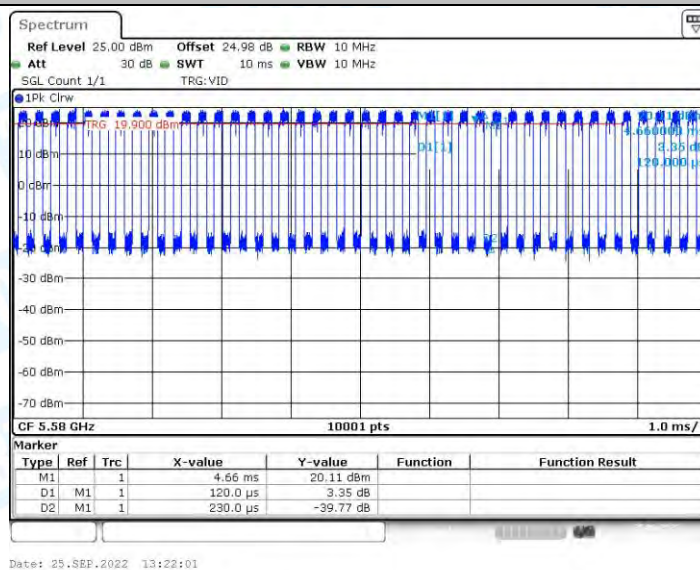


11A\_Ant2\_5580

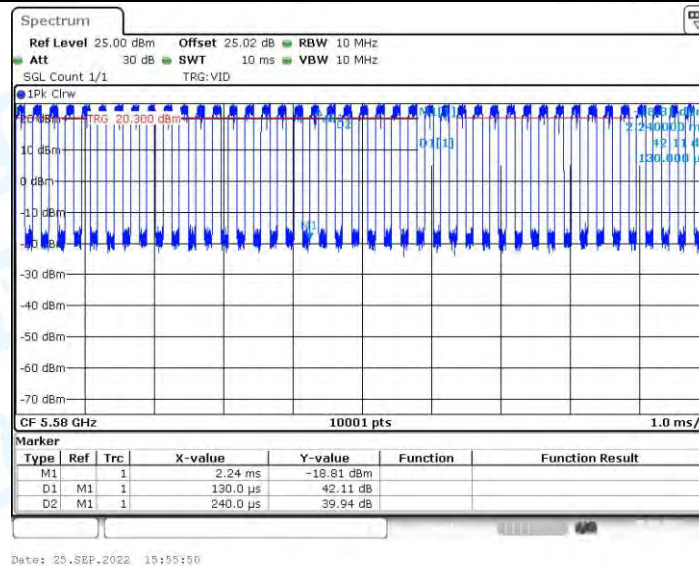


11A\_Ant1\_5700

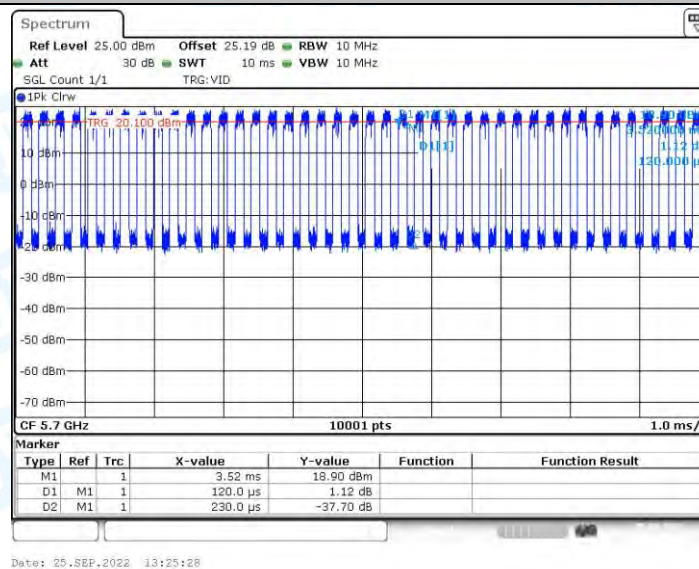


11A\_Ant2\_5700

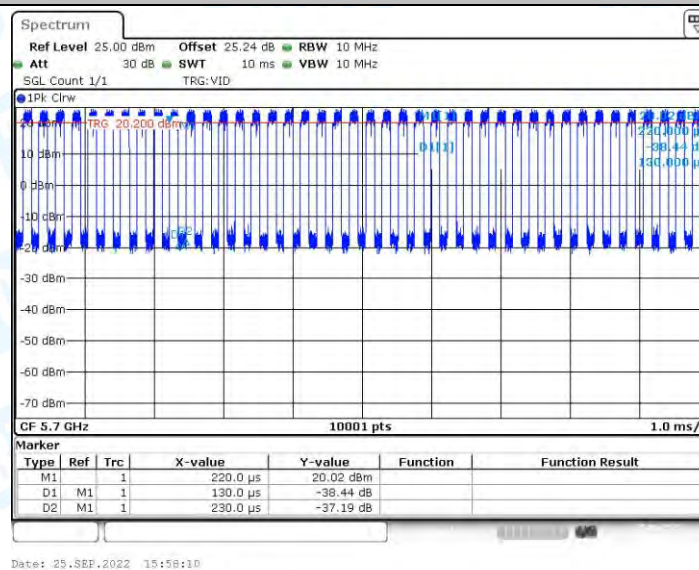


11A\_Ant1\_5720

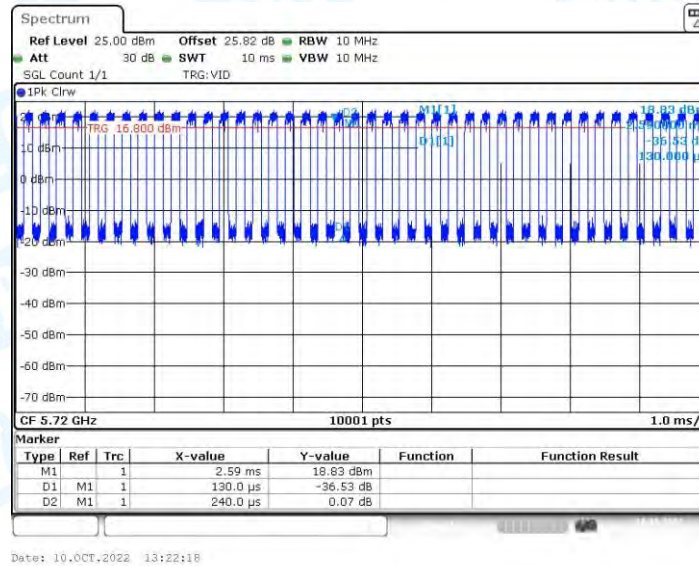


11A\_Ant2\_5720

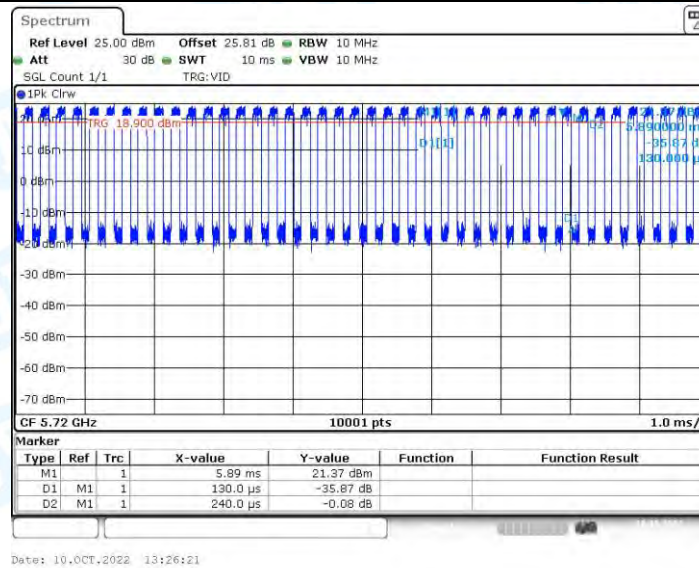


11A\_Ant1\_5745

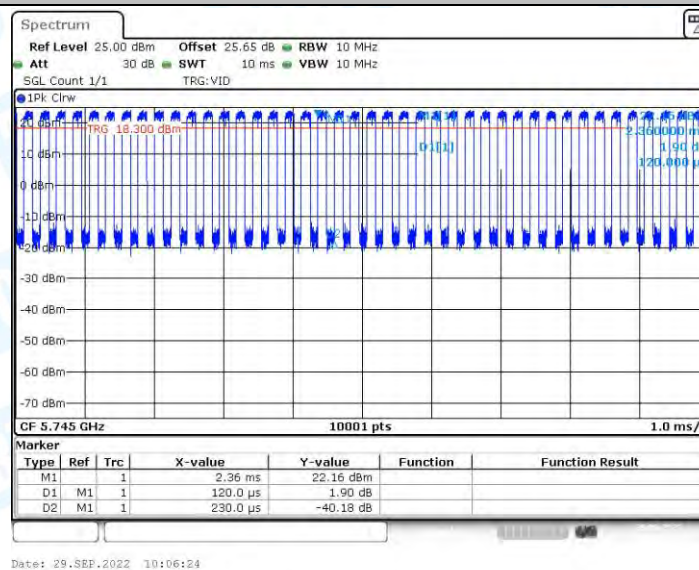


11A\_Ant2\_5745

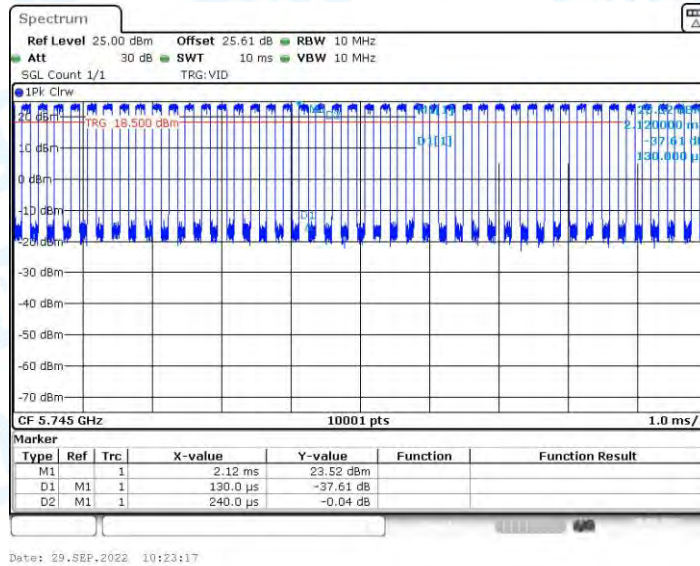


11A\_Ant1\_5785

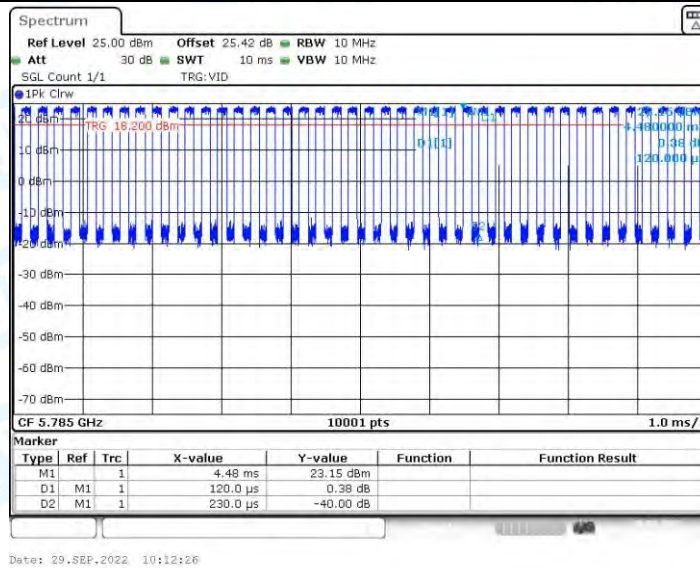


11A\_Ant2\_5785

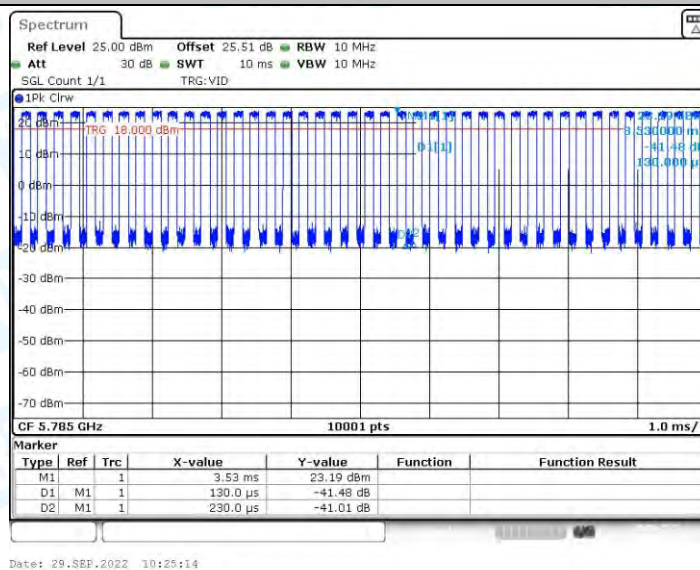


11A\_Ant1\_5825

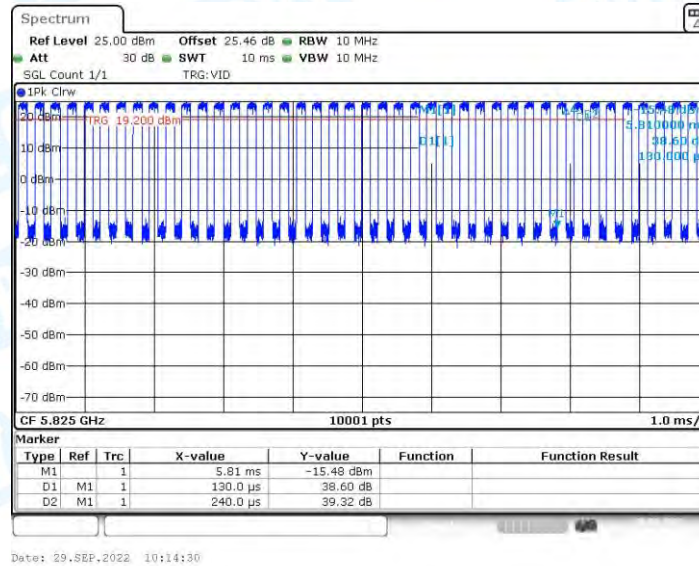


11A\_Ant2\_5825

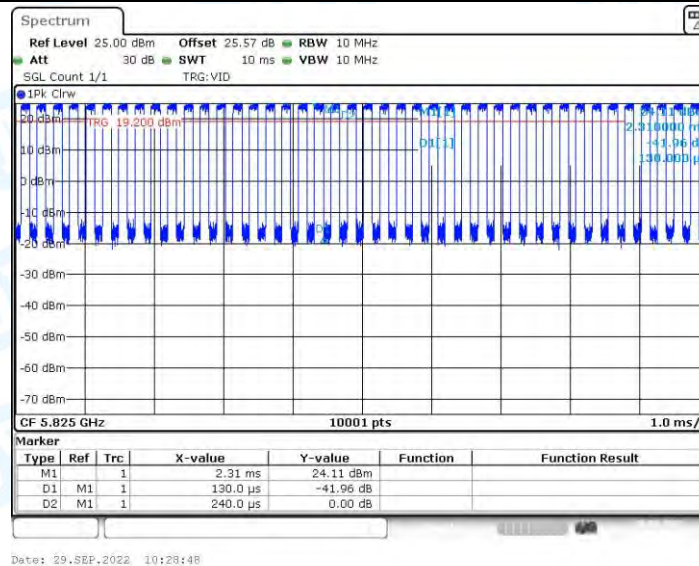


11N20-SDM\_Ant1\_5180

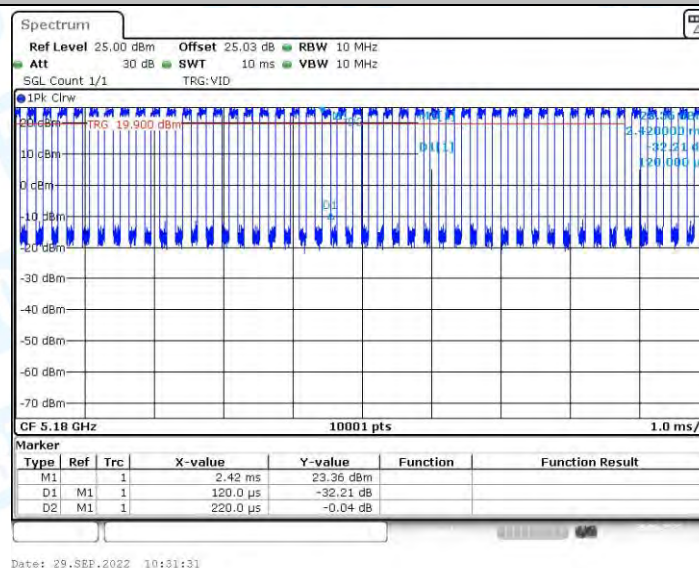


11N20-SDM\_Ant2\_5180

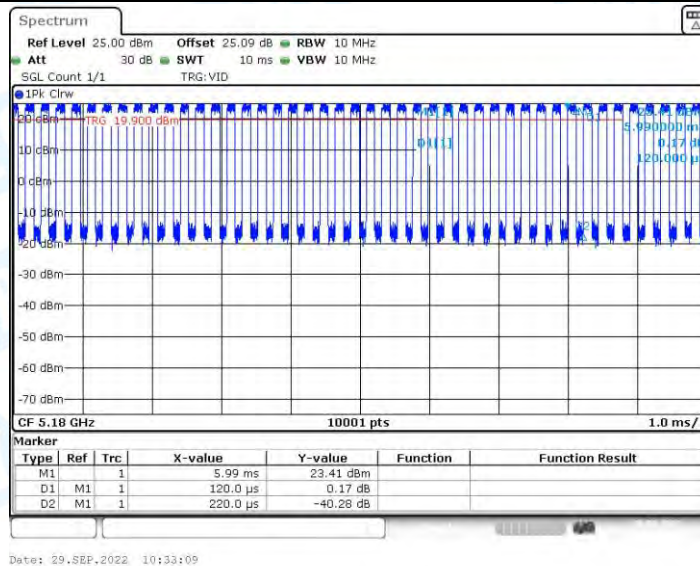


### 11N20-SDM\_Ant1\_5200

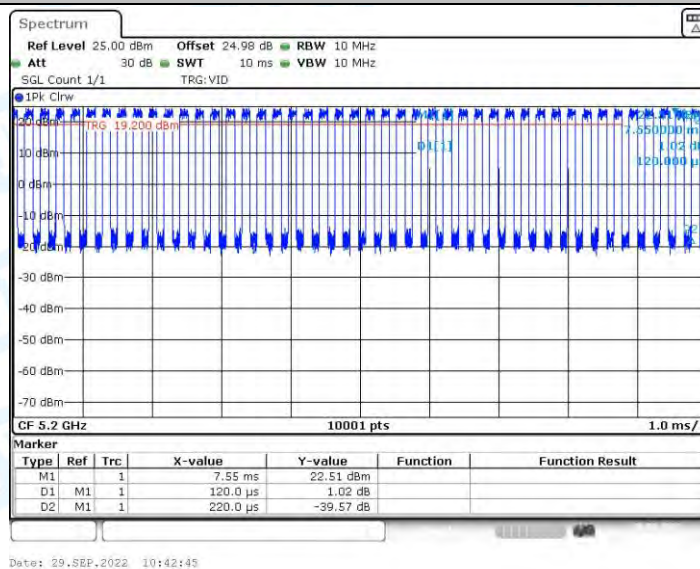


### 11N20-SDM\_Ant2\_5200

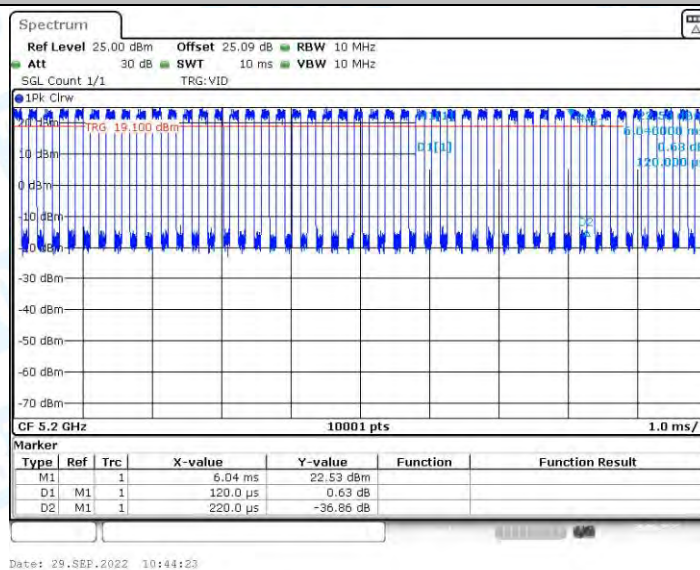


### 11N20-SDM\_Ant1\_5240

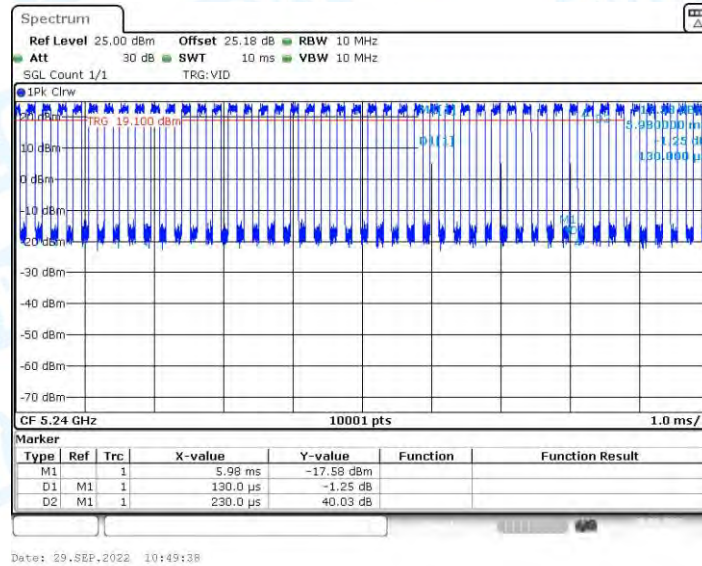


11N20-SDM\_Ant2\_5240

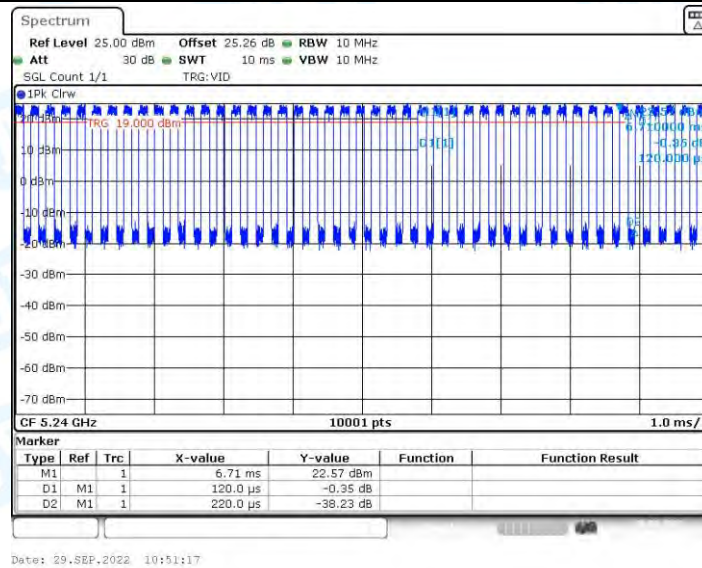


11N20-SDM\_Ant1\_5260

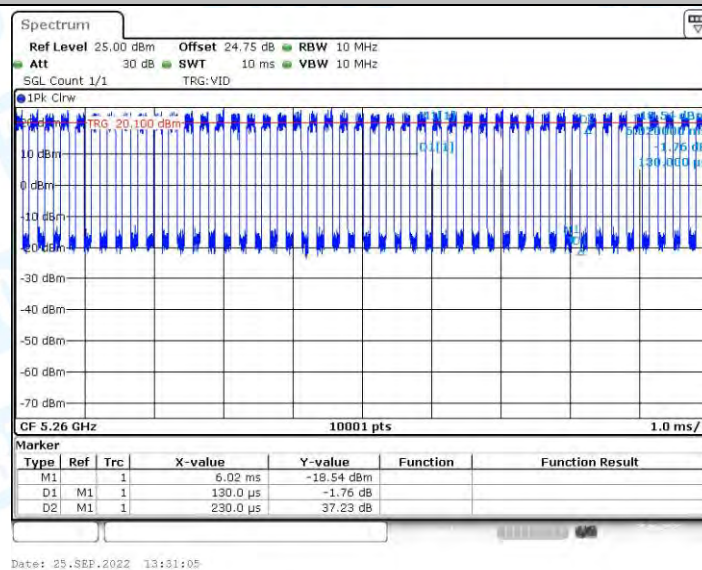


11N20-SDM\_Ant2\_5260

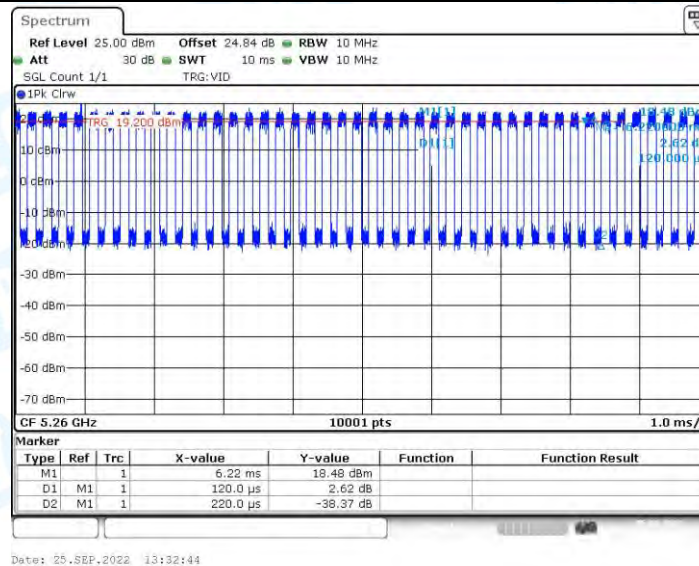


### 11N20-SDM\_Ant1\_5280

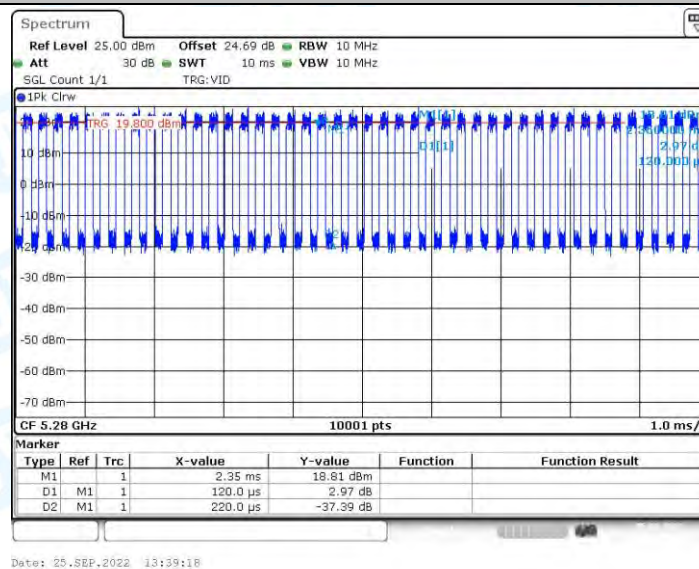


### 11N20-SDM\_Ant2\_5280

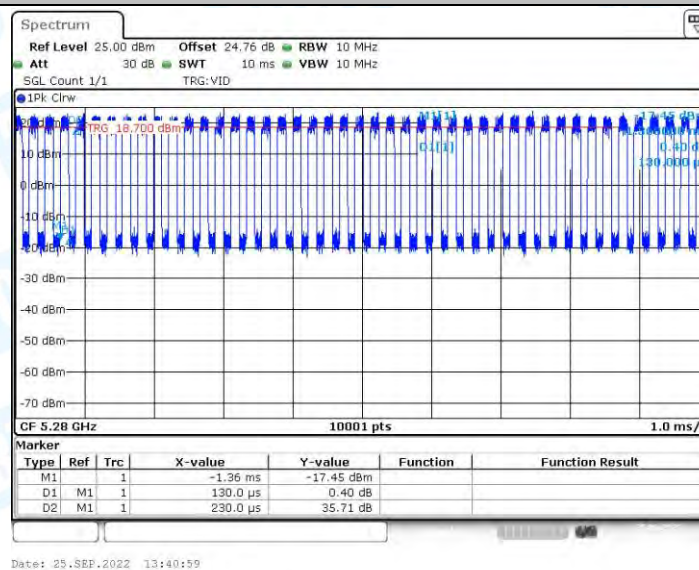


### 11N20-SDM\_Ant1\_5320

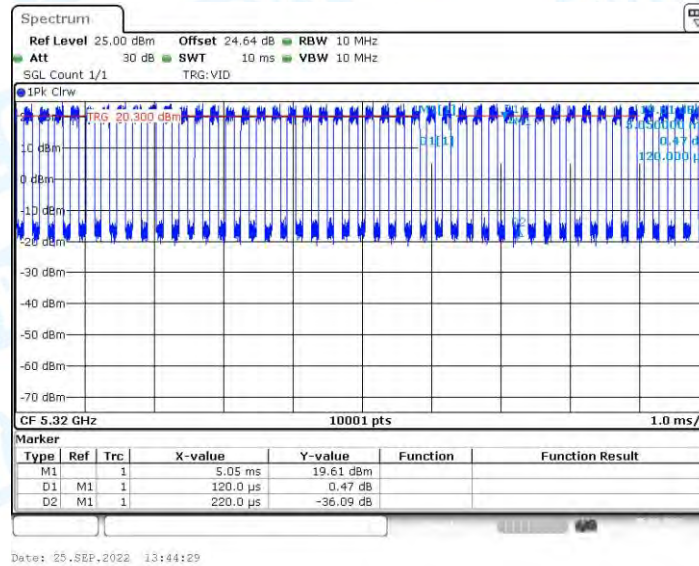


### 11N20-SDM\_Ant2\_5320

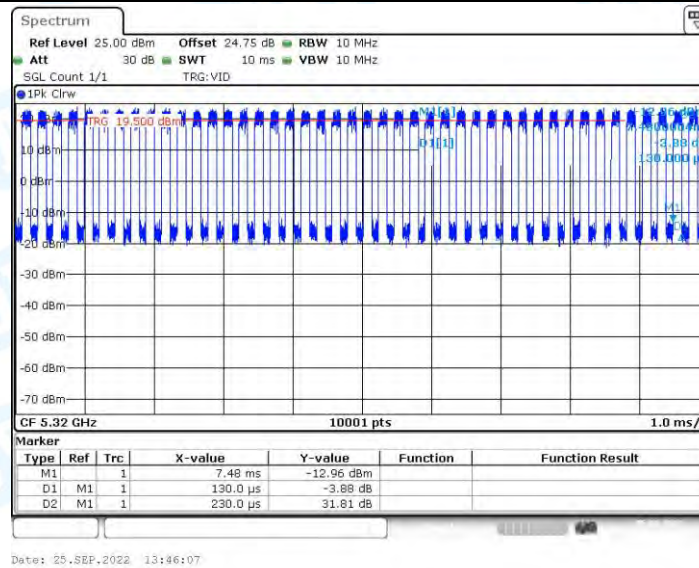


### 11N20-SDM\_Ant1\_5500

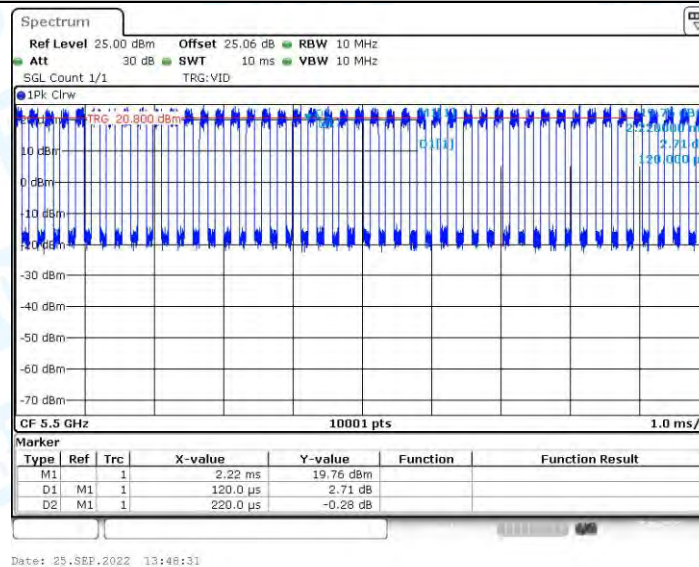


### 11N20-SDM\_Ant2\_5500

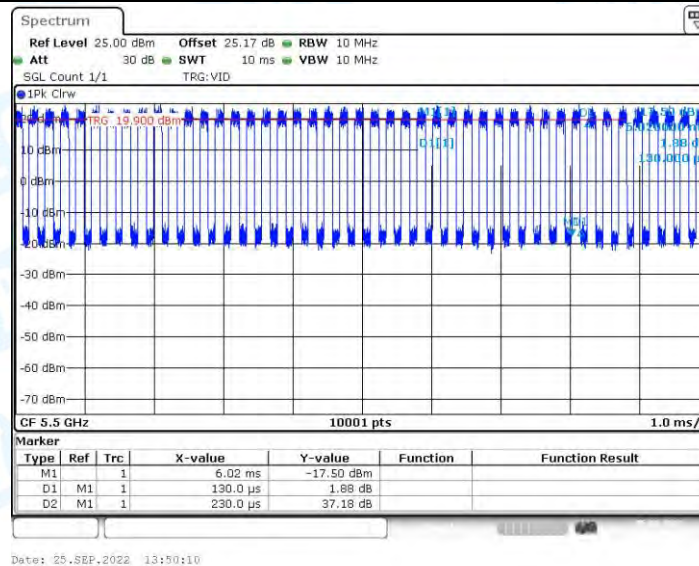


### 11N20-SDM\_Ant1\_5580

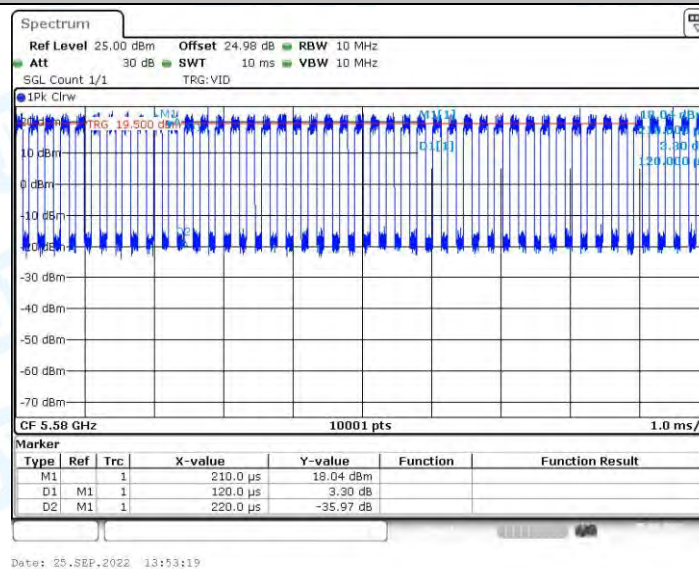


### 11N20-SDM\_Ant2\_5580

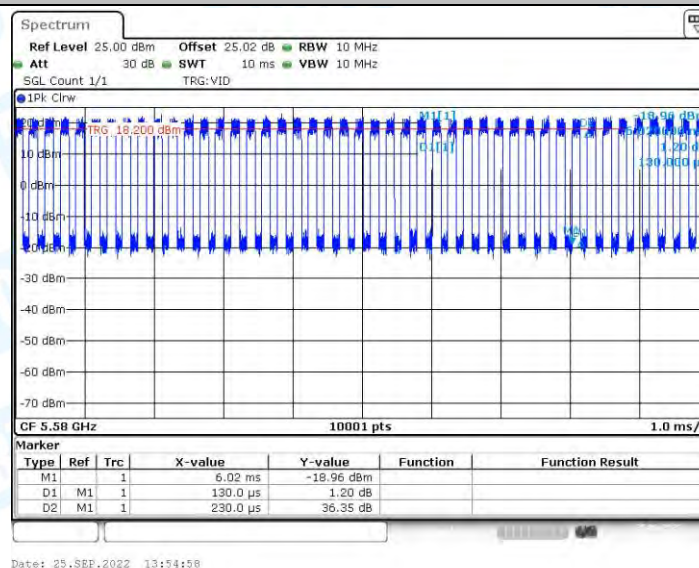


### 11N20-SDM\_Ant1\_5700

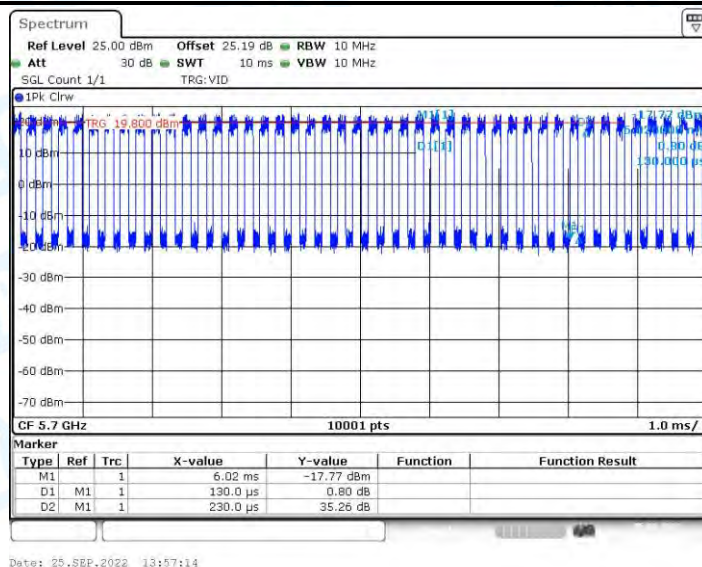


11N20-SDM\_Ant2\_5700

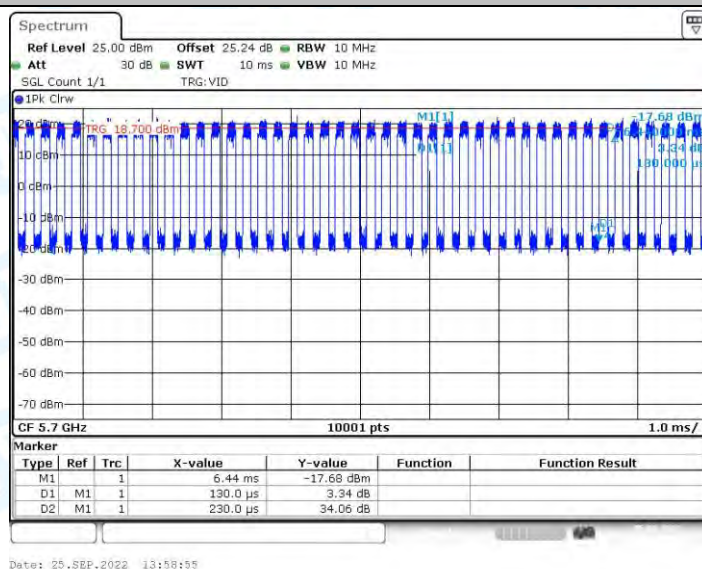


11N20-SDM\_Ant1\_5720

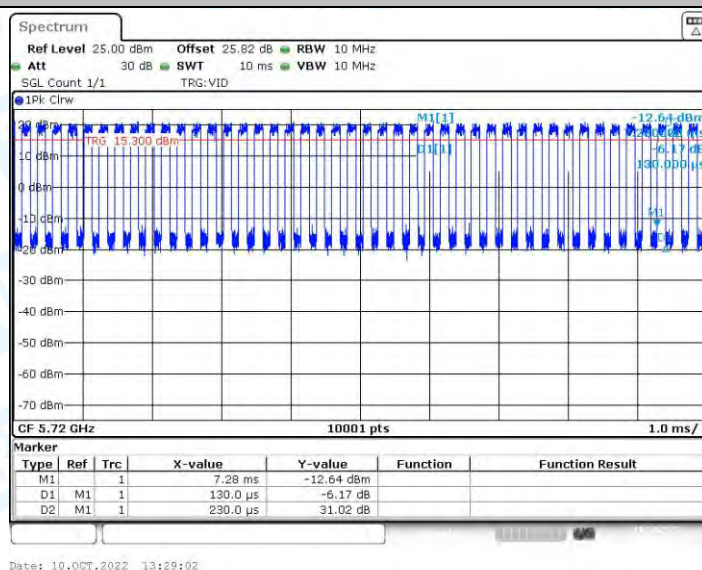


11N20-SDM\_Ant2\_5720

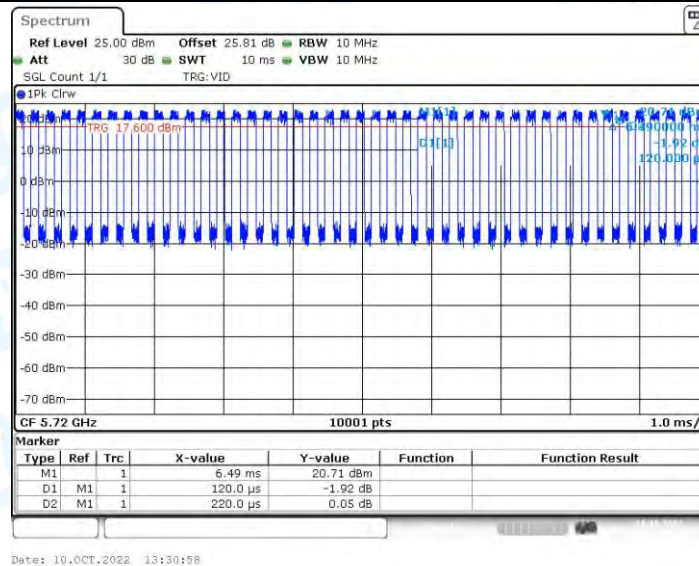


### 11N20-SDM\_Ant1\_5745

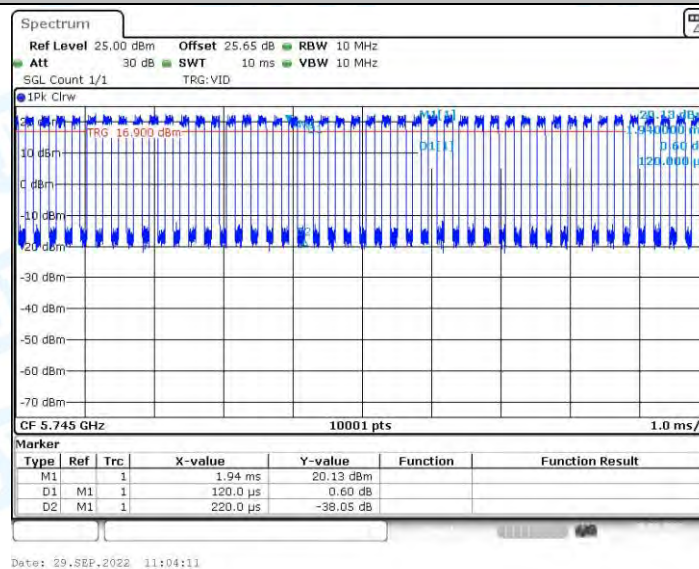


### 11N20-SDM\_Ant2\_5745

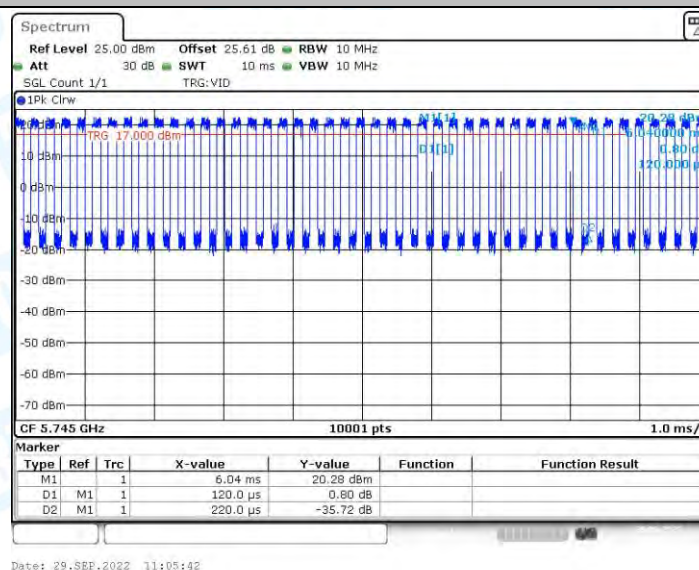


### 11N20-SDM\_Ant1\_5785

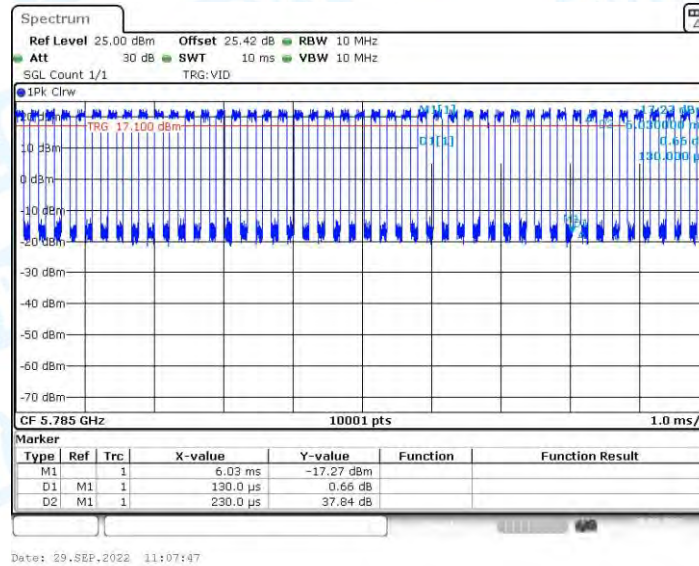


### 11N20-SDM\_Ant2\_5785

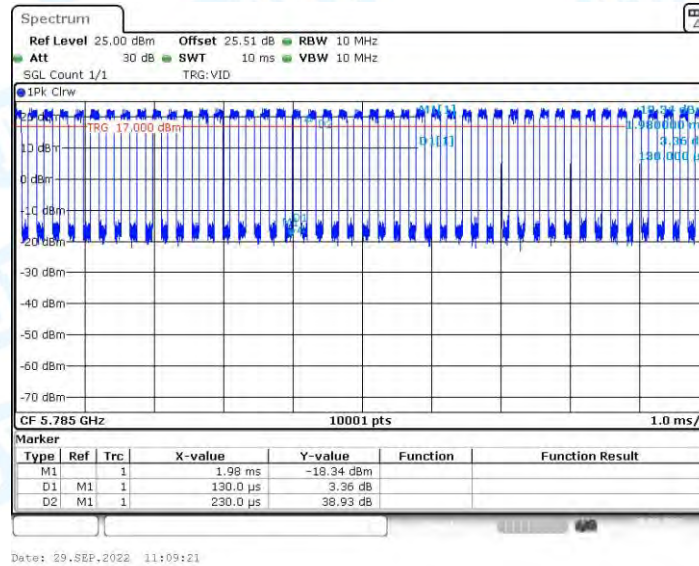


### 11N20-SDM\_Ant1\_5825

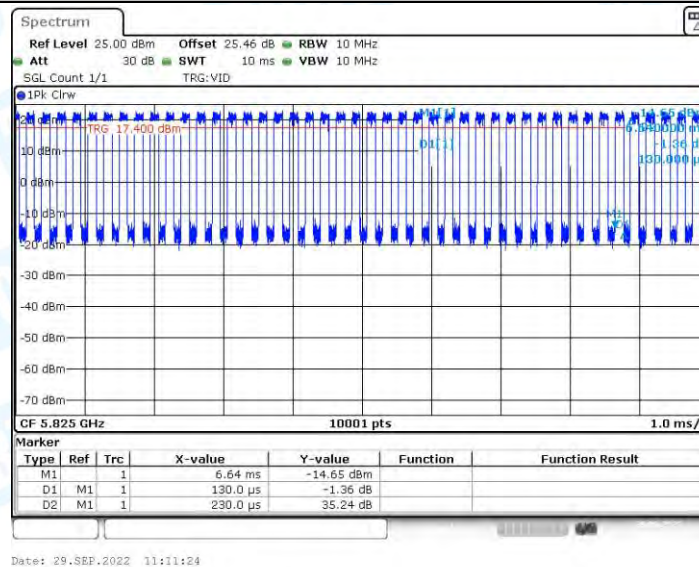


### 11N20-SDM\_Ant2\_5825

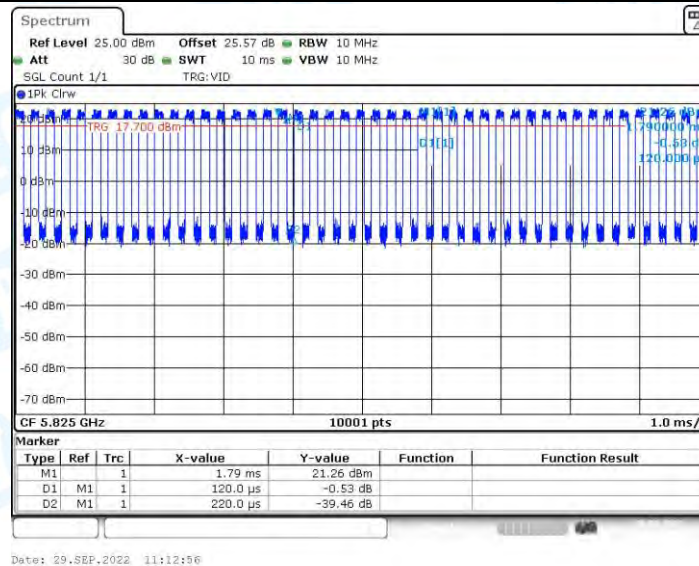


### 11N40-SDM\_Ant1\_5190

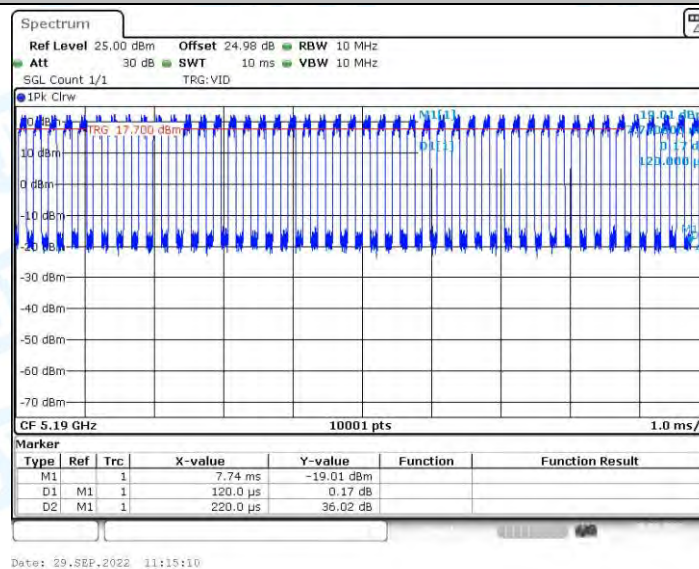


### 11N40-SDM\_Ant2\_5190

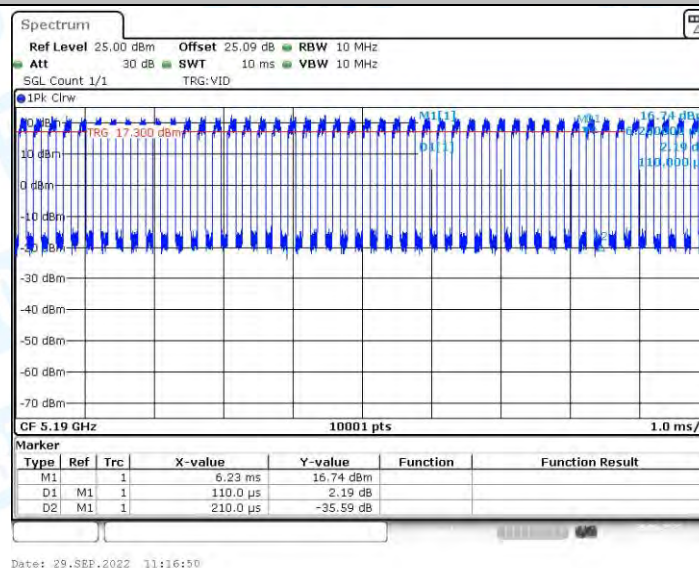


### 11N40-SDM\_Ant1\_5230

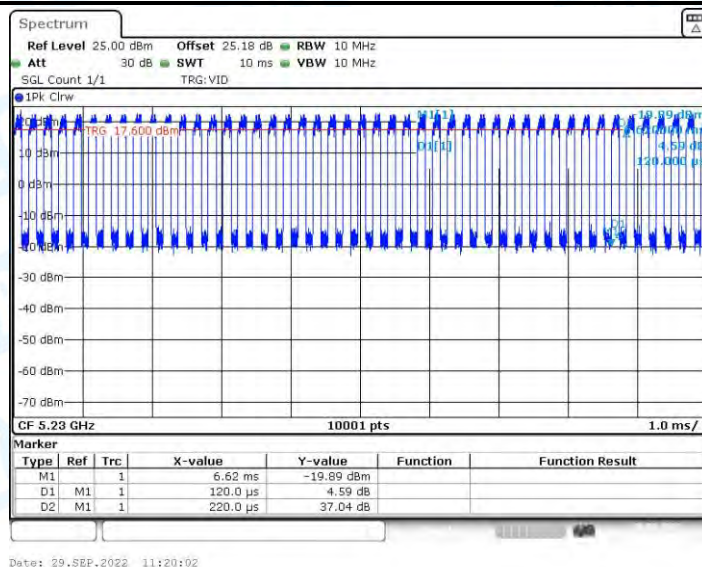


11N40-SDM\_Ant2\_5230

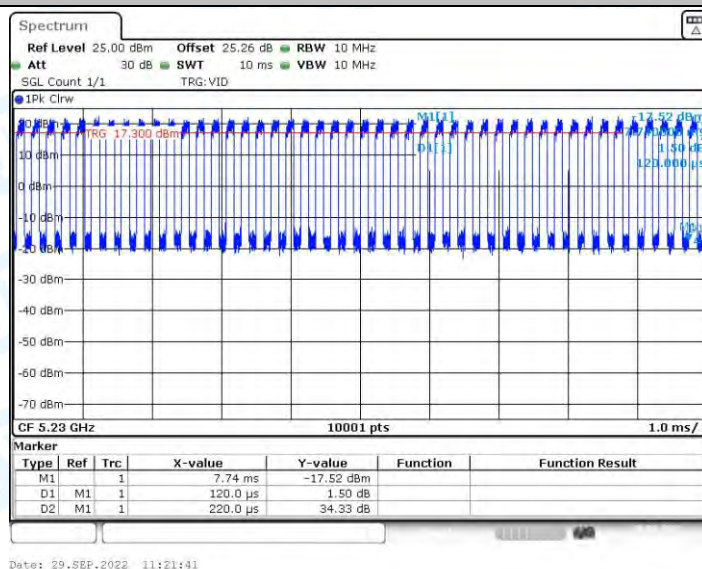


11N40-SDM\_Ant1\_5270

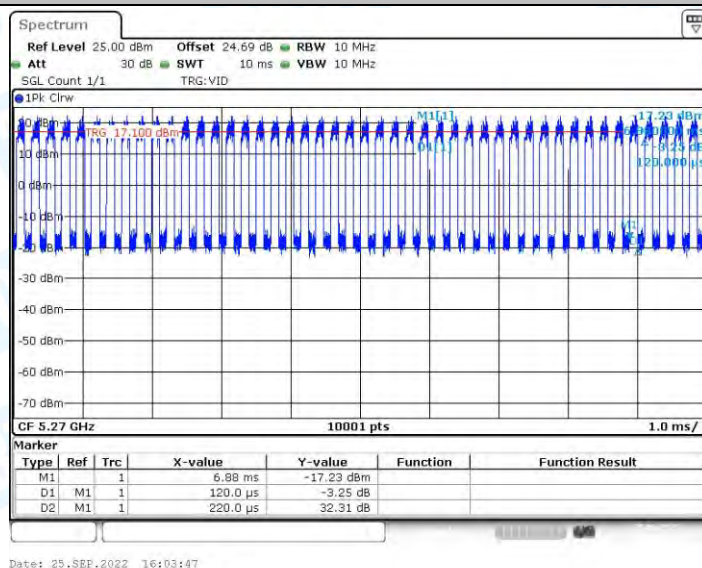


11N40-SDM\_Ant2\_5270

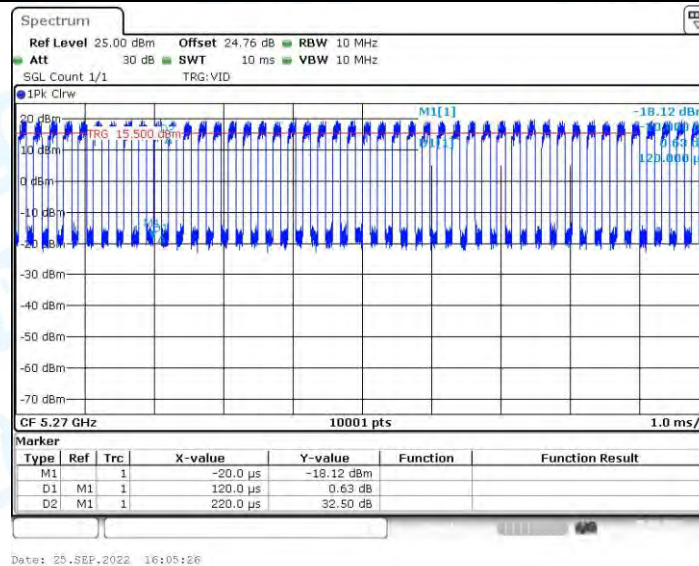


### 11N40-SDM\_Ant1\_5310

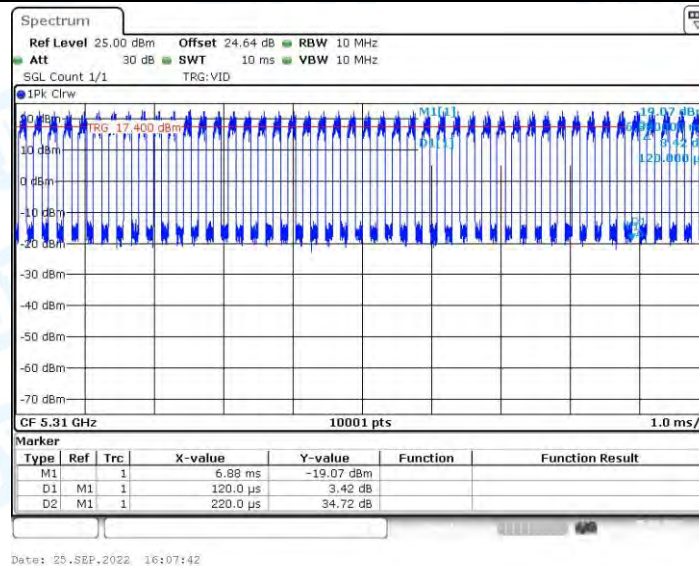


### 11N40-SDM\_Ant2\_5310

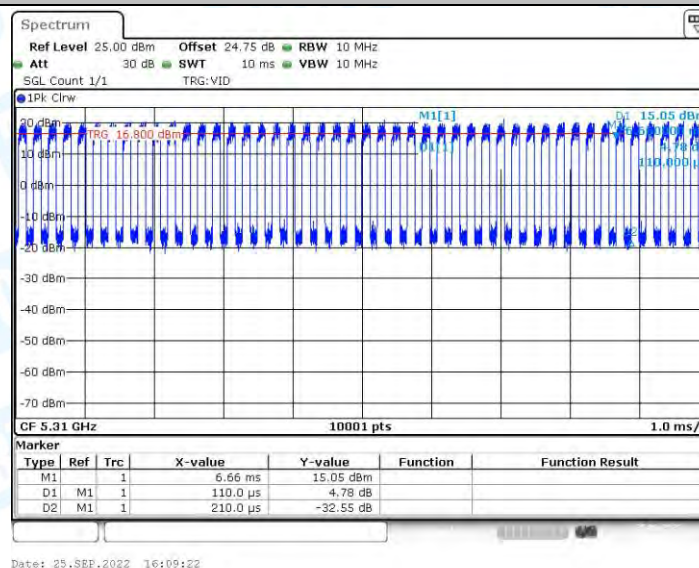


### 11N40-SDM\_Ant1\_5510

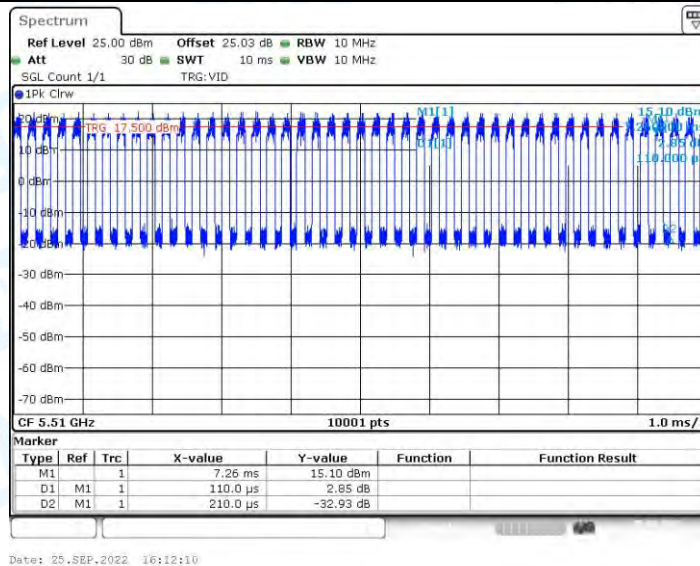


11N40-SDM\_Ant2\_5510

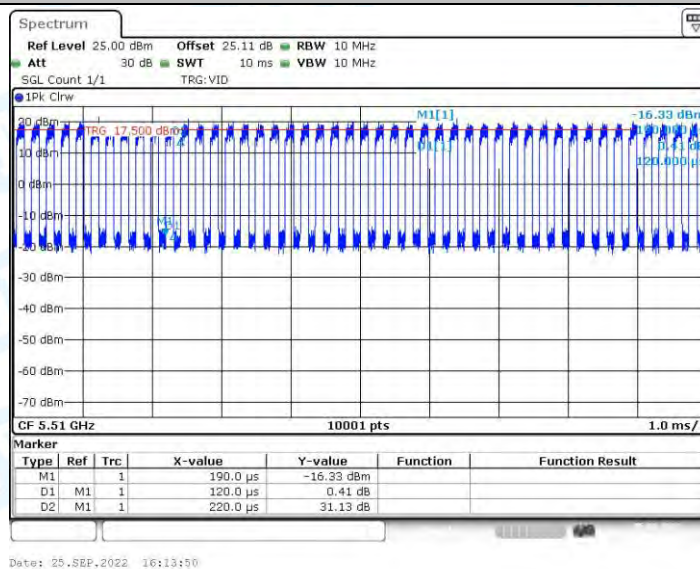


11N40-SDM\_Ant1\_5550

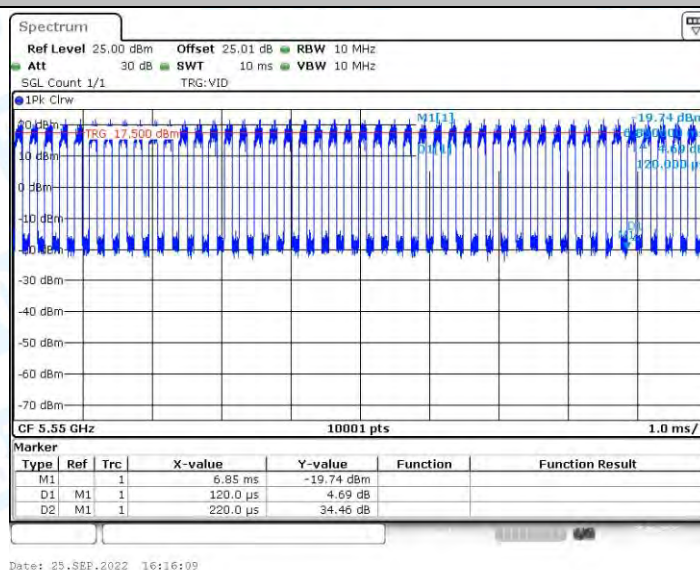


11N40-SDM\_Ant2\_5550

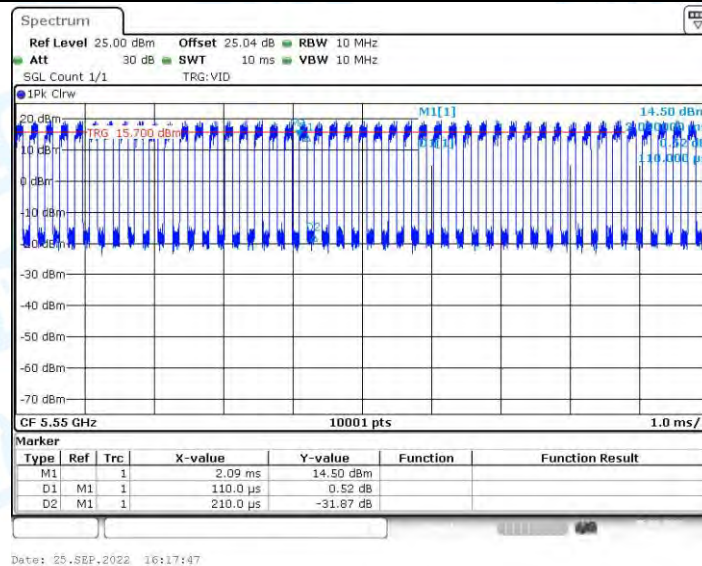


11N40-SDM\_Ant1\_5670

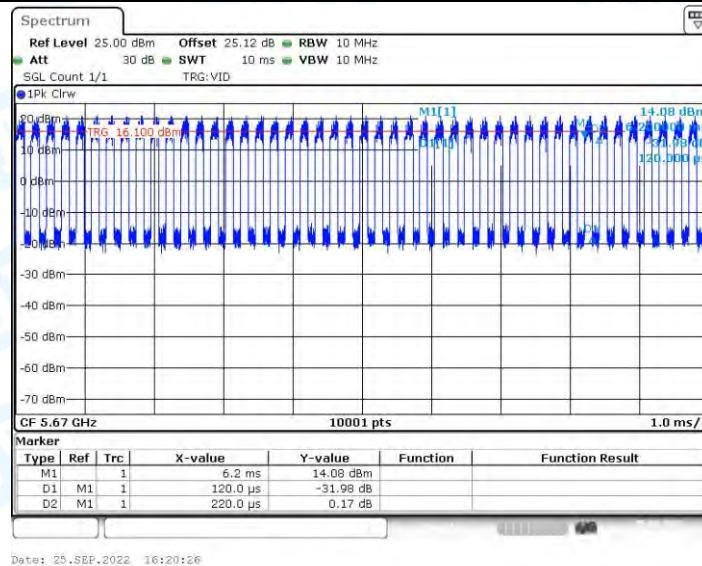


11N40-SDM\_Ant2\_5670

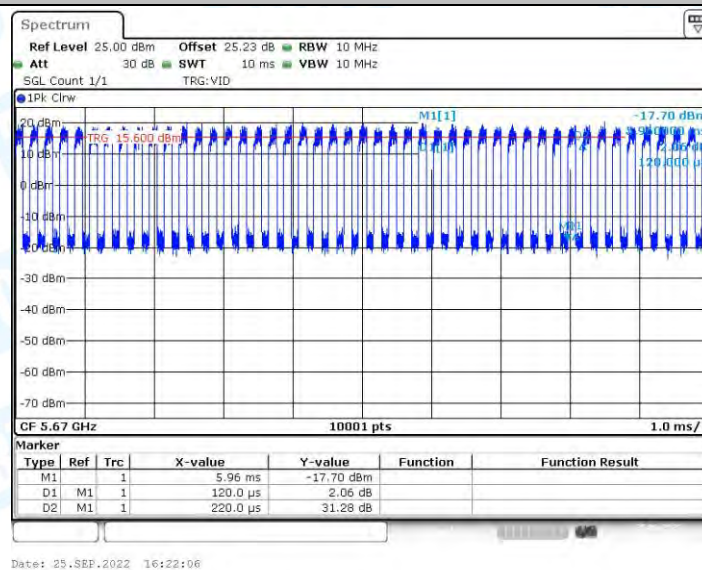


11N40-SDM\_Ant1\_5710

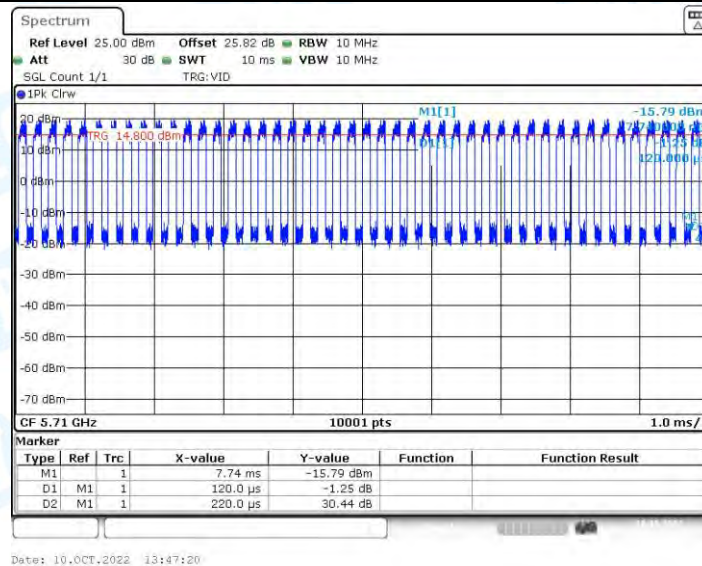


### 11N40-SDM\_Ant2\_5710

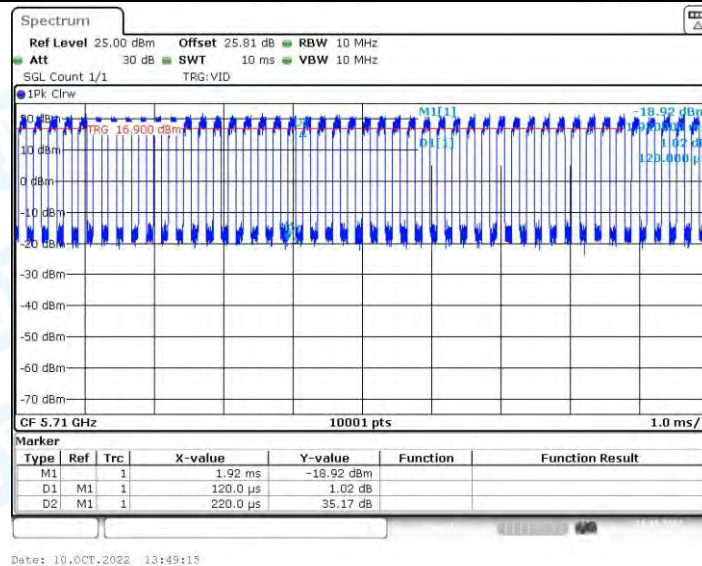


### 11N40-SDM\_Ant1\_5755

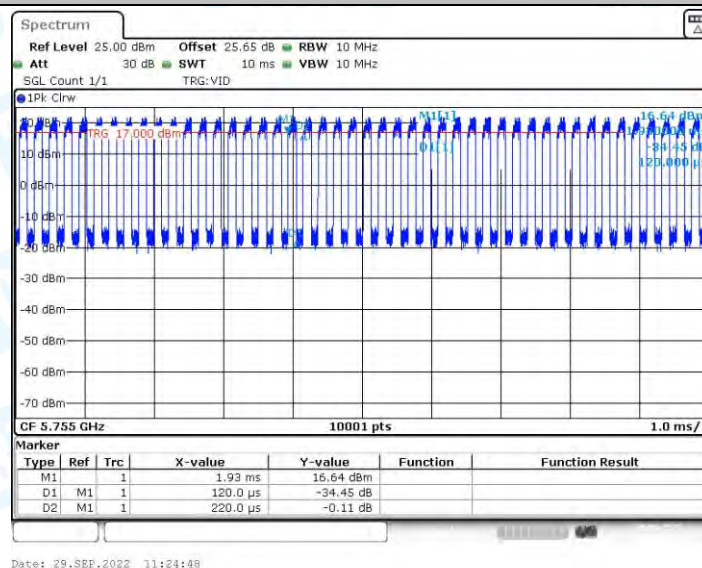


### 11N40-SDM\_Ant2\_5755

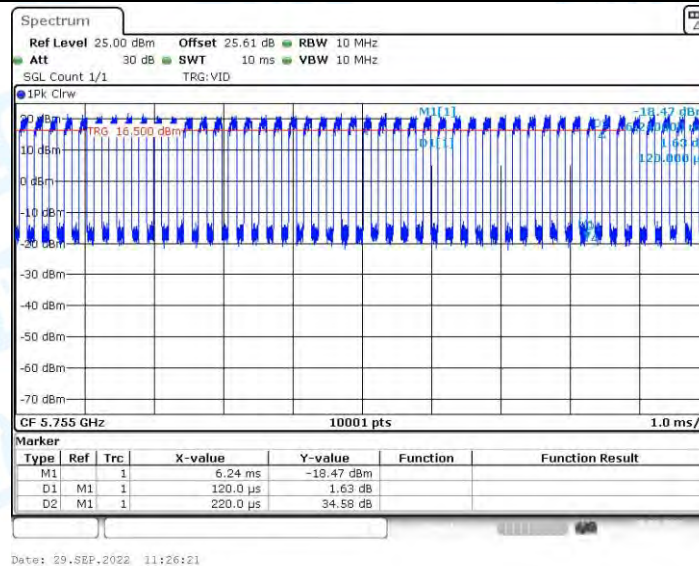


11N40-SDM\_Ant1\_5795

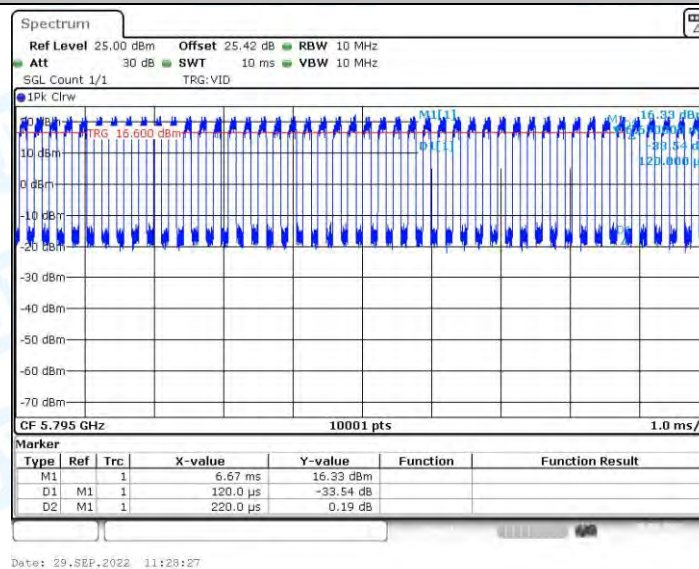


11N40-SDM\_Ant2\_5795

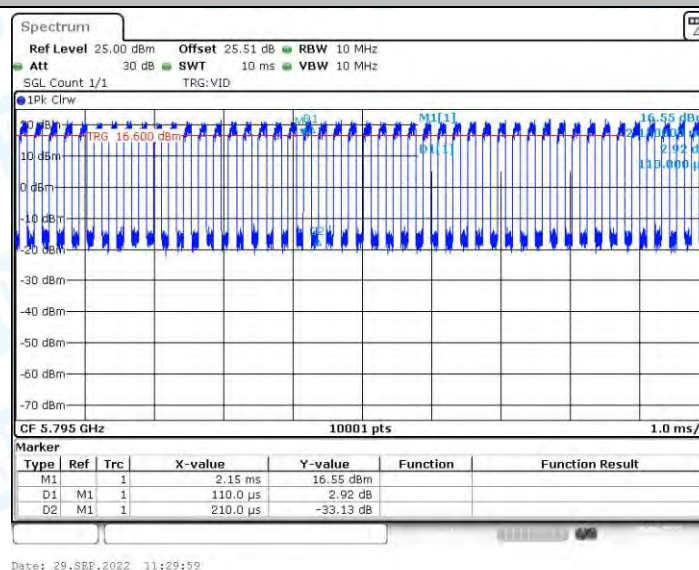


11AC20-SDM\_Ant1\_5180

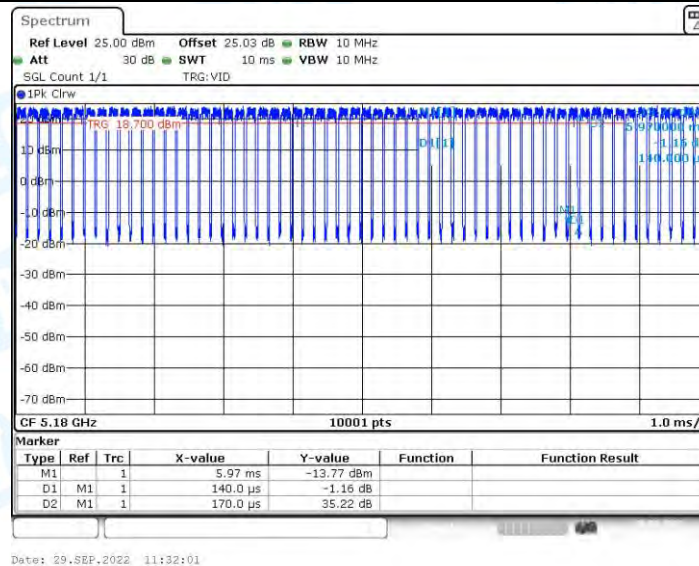


### 11AC20-SDM\_Ant2\_5180

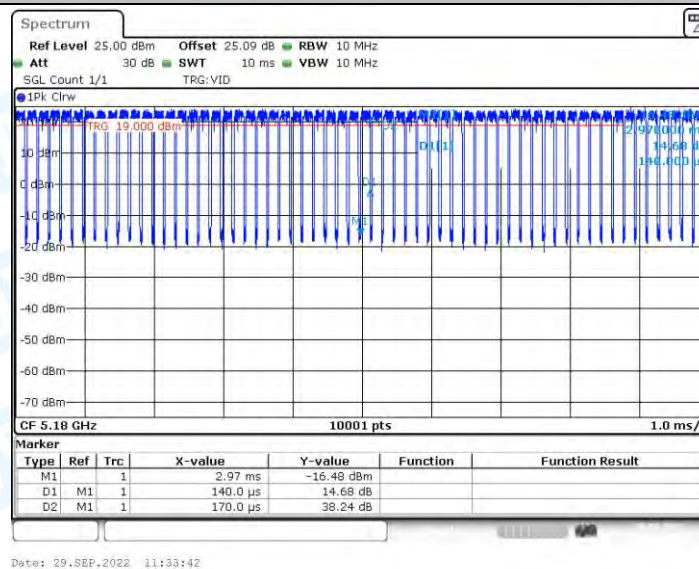


### 11AC20-SDM\_Ant1\_5200

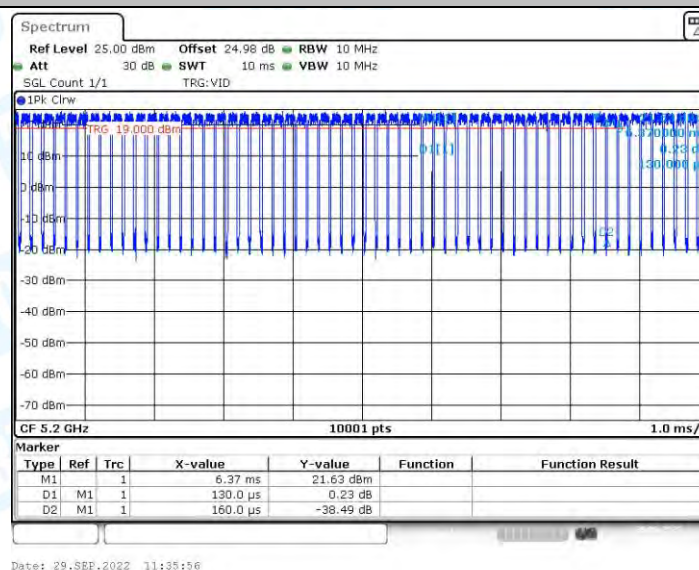


### 11AC20-SDM\_Ant2\_5200

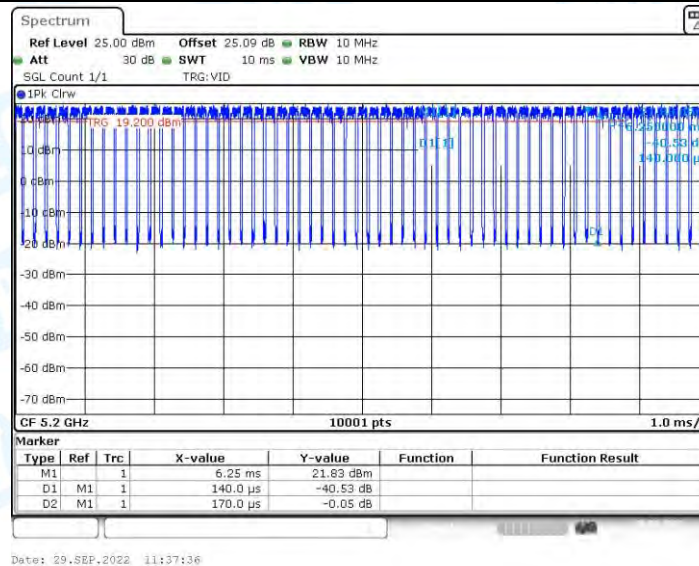

11AC20-SDM\_Ant1\_5240

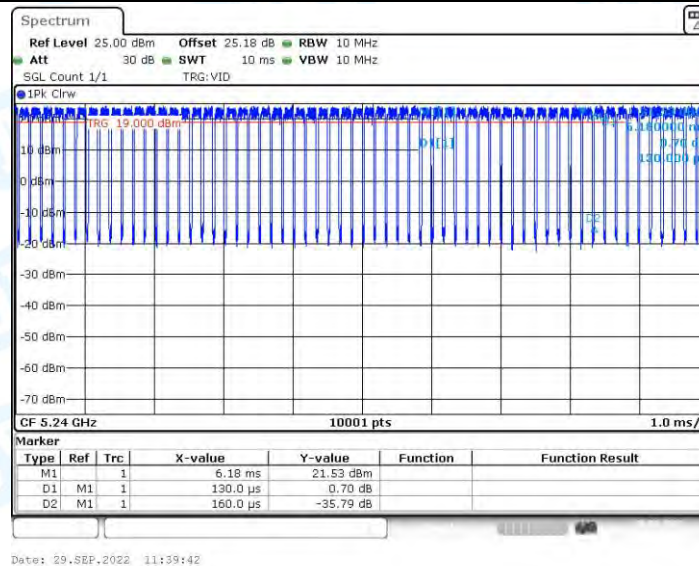

11AC20-SDM\_Ant2\_5240

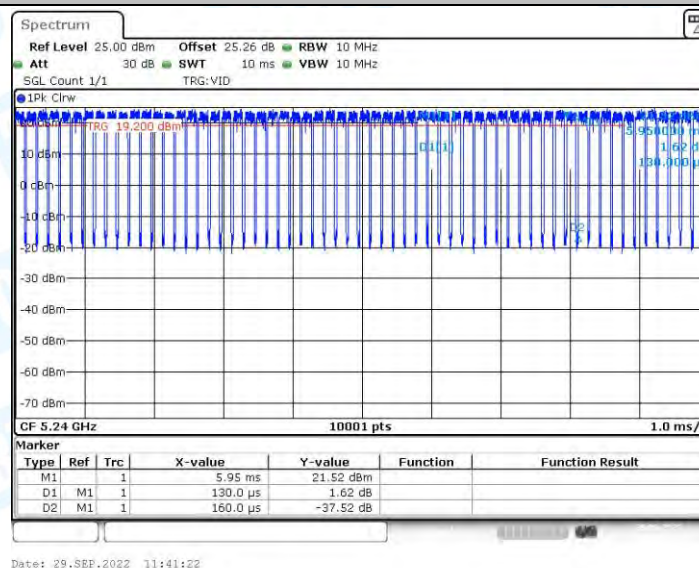

11AC20-SDM\_Ant1\_5260