




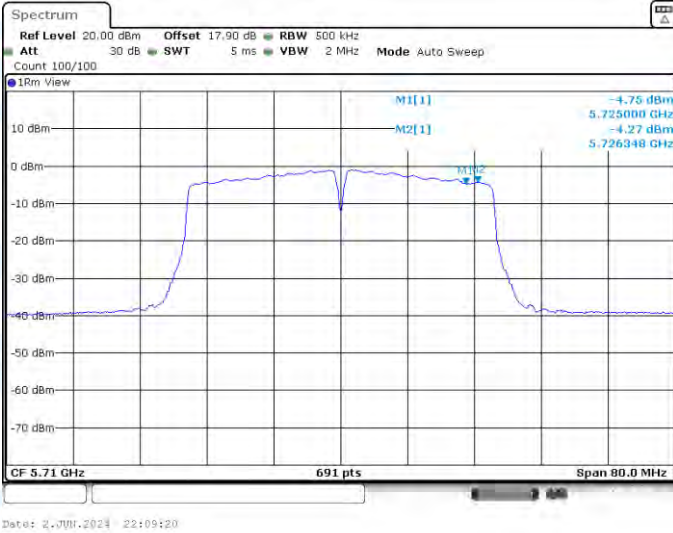

11N40-CDD-Ant1-5710_UNII-3-PASS

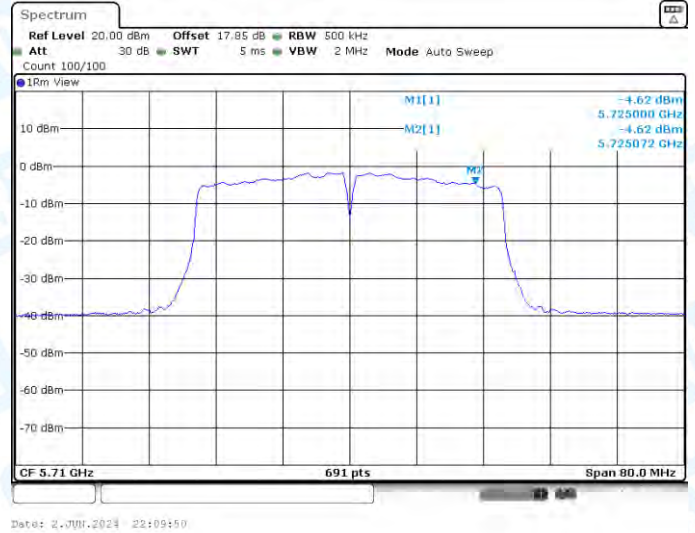

11N40-CDD-Ant2-5710_UNII-3-PASS

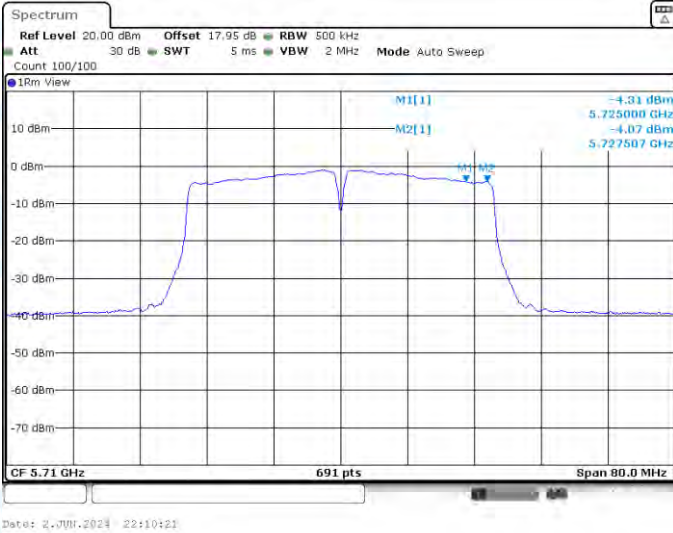

11N40-CDD-Ant3-5710_UNII-3-PASS



11N40-CDD-Ant1-5755-PASS




11N40-CDD-Ant2-5755-PASS



11N40-CDD-Ant3-5755-PASS




11N40-CDD-Ant1-5795-PASS

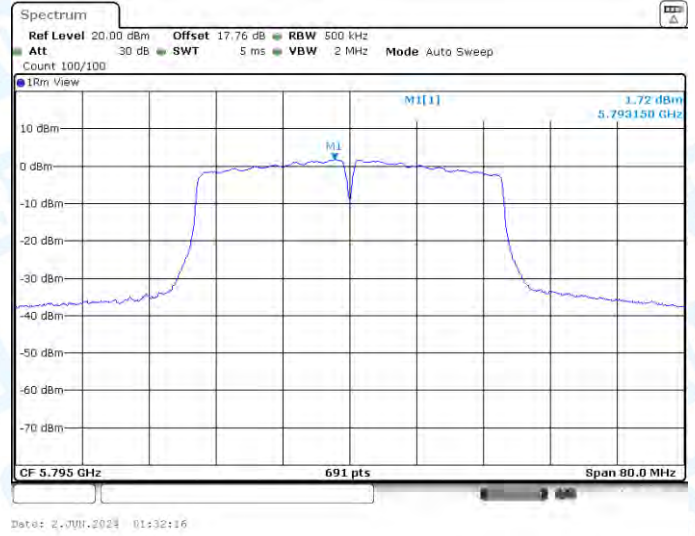


11N40-CDD-Ant2-5795-PASS




11N40-CDD-Ant3-5795-PASS

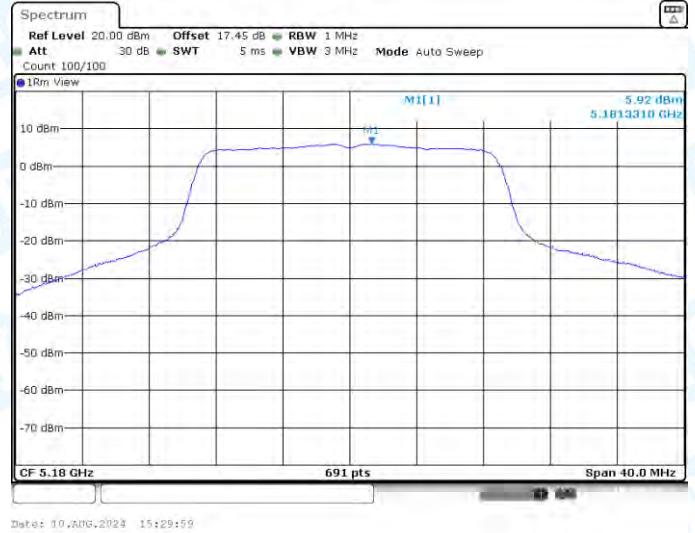

11AC20-CDD-Ant1-5180-PASS

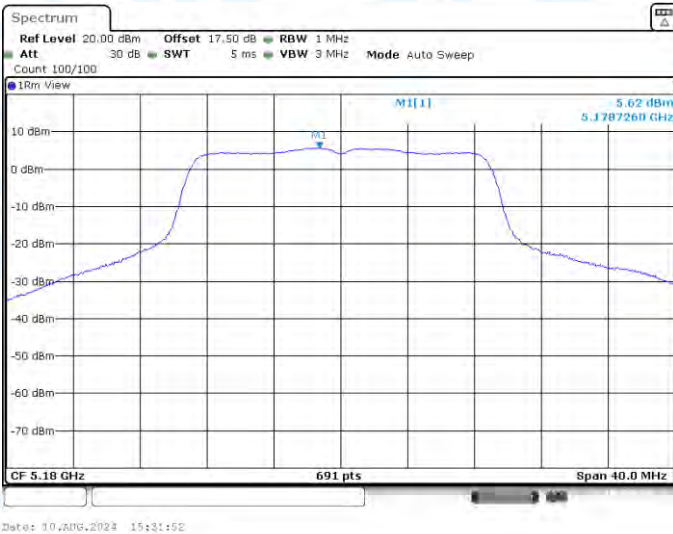

11AC20-CDD-Ant2-5180-PASS

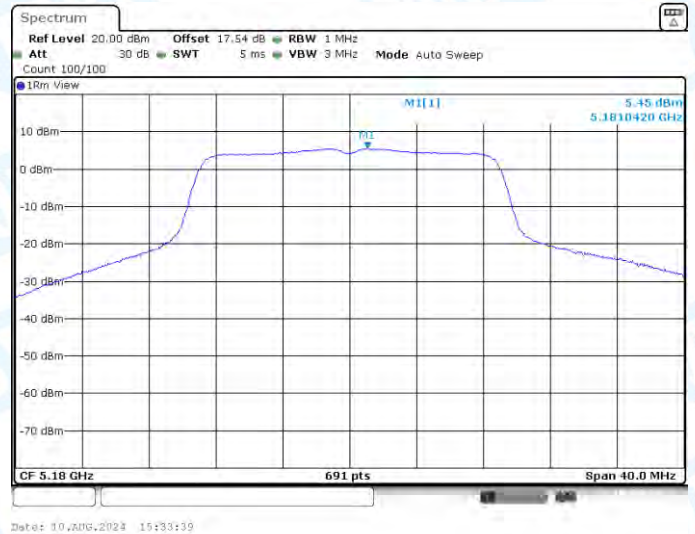

11AC20-CDD-Ant3-5180-PASS



11AC20-CDD-Ant1-5200-PASS




11AC20-CDD-Ant2-5200-PASS



11AC20-CDD-Ant3-5200-PASS




11AC20-CDD-Ant1-5240-PASS

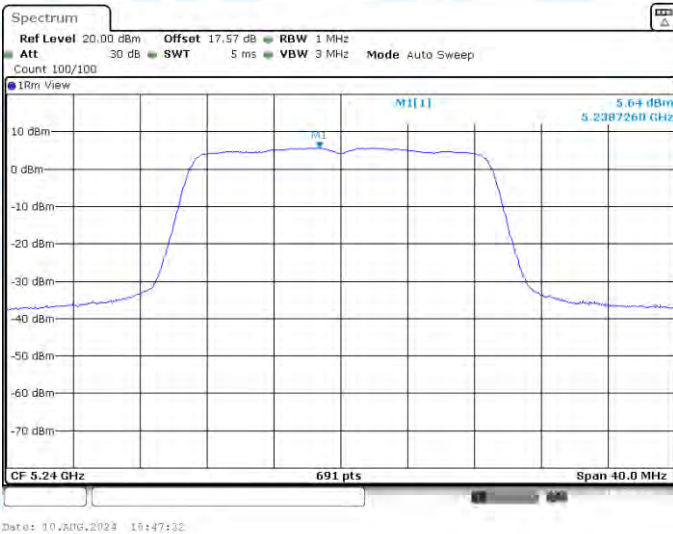

11AC20-CDD-Ant2-5240-PASS




11AC20-CDD-Ant3-5240-PASS

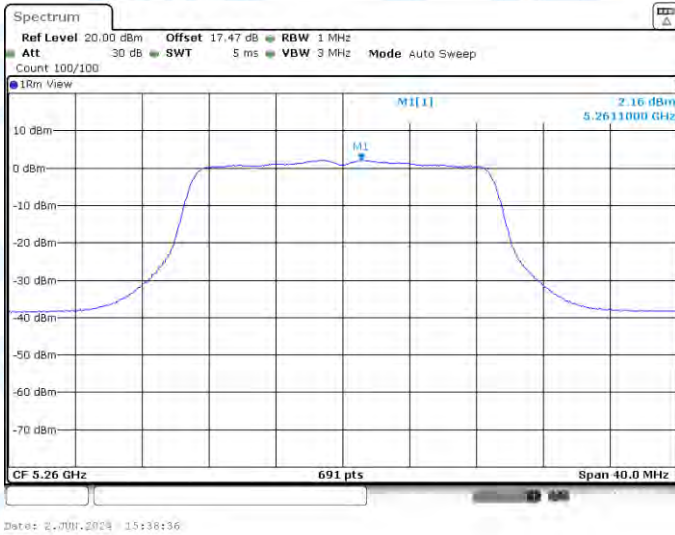


11AC20-CDD-Ant1-5260-PASS



11AC20-CDD-Ant2-5260-PASS

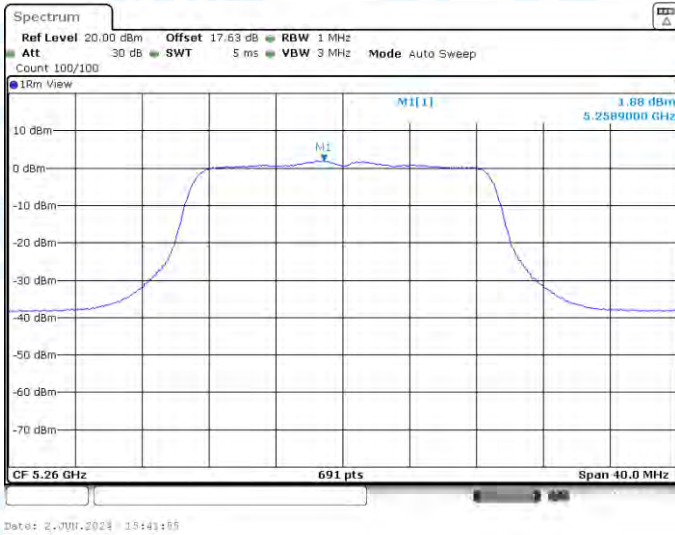


11AC20-CDD-Ant3-5260-PASS

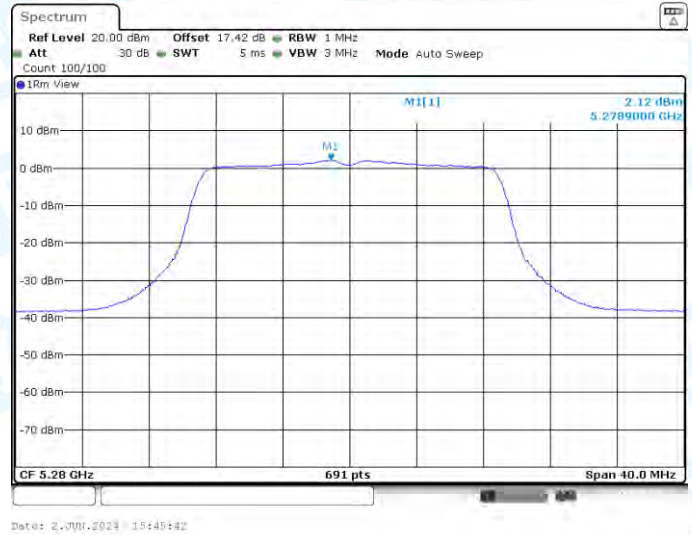


11AC20-CDD-Ant1-5280-PASS



11AC20-CDD-Ant2-5280-PASS

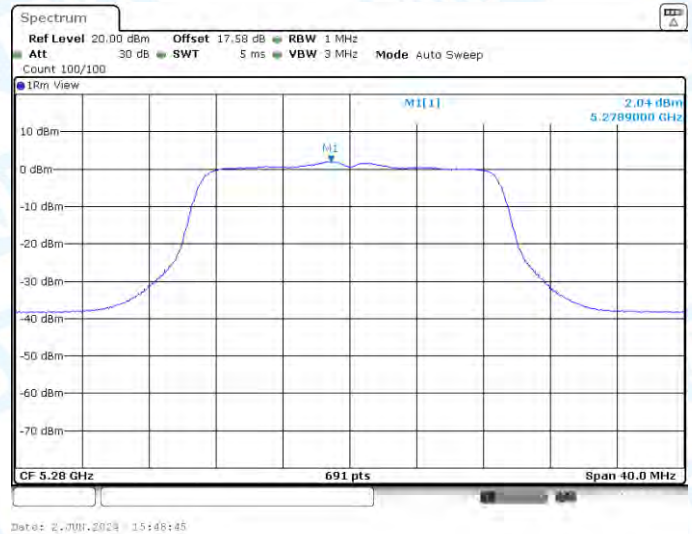


11AC20-CDD-Ant3-5280-PASS

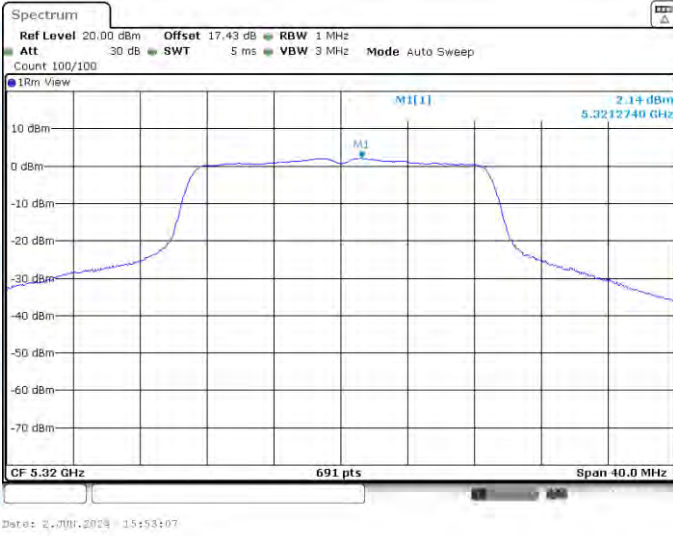


11AC20-CDD-Ant1-5320-PASS




11AC20-CDD-Ant2-5320-PASS

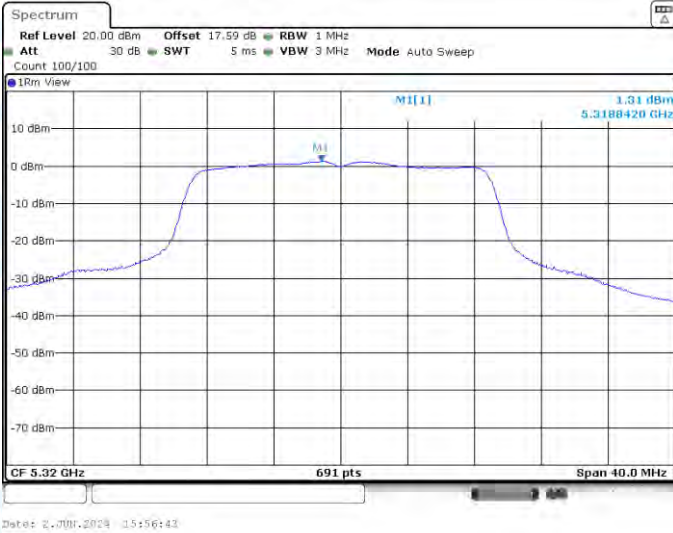


11AC20-CDD-Ant3-5320-PASS

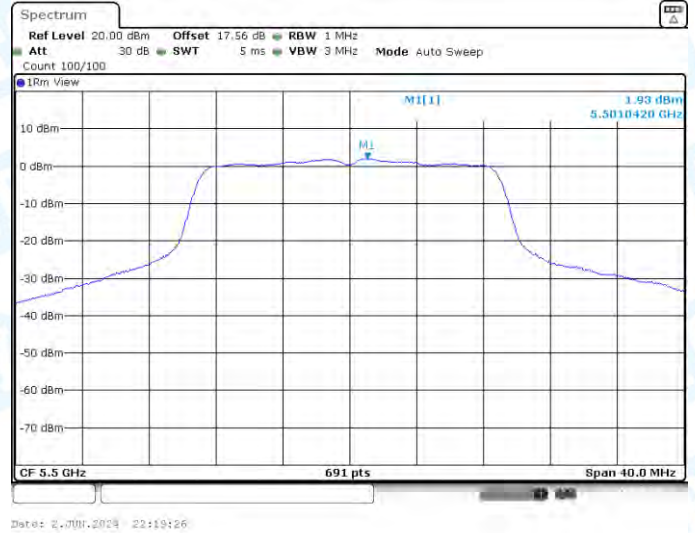


11AC20-CDD-Ant1-5500-PASS

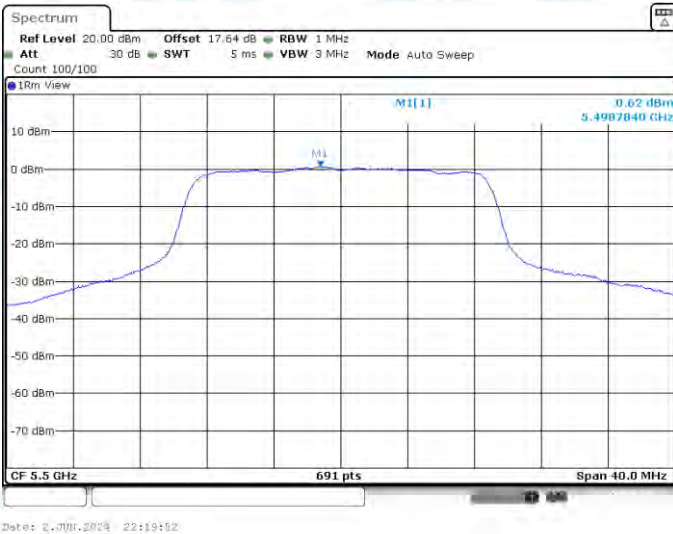


11AC20-CDD-Ant2-5500-PASS

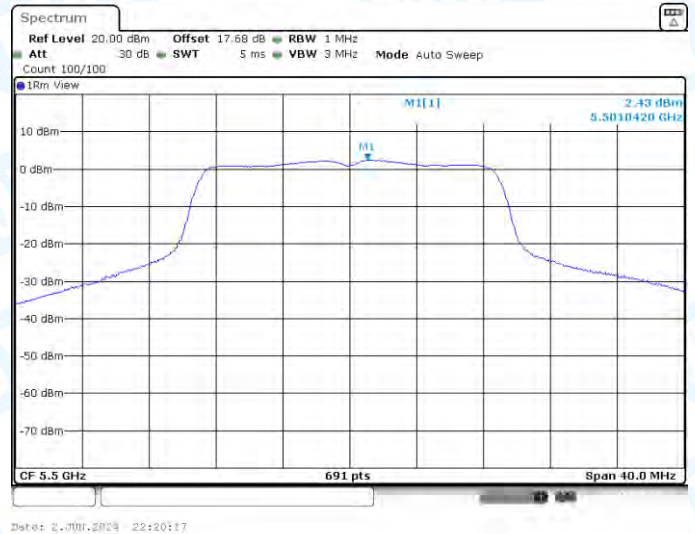


11AC20-CDD-Ant3-5500-PASS

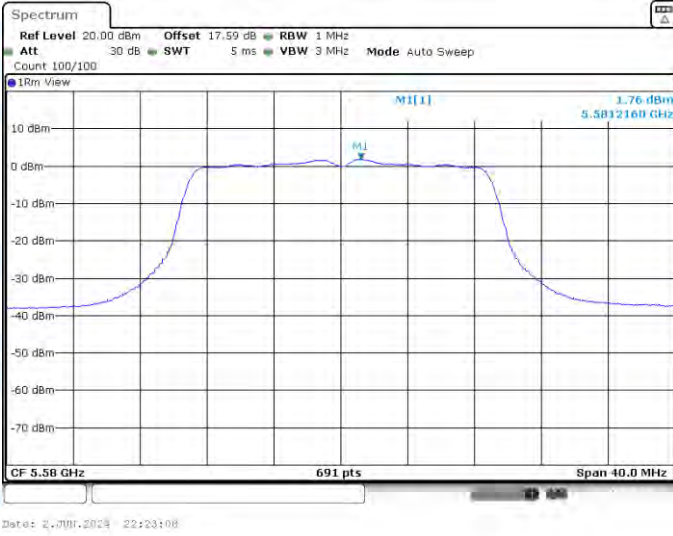


11AC20-CDD-Ant1-5580-PASS

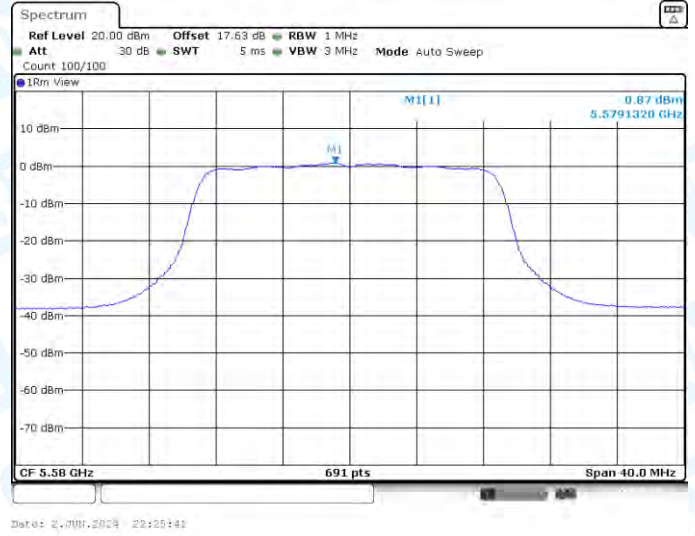


11AC20-CDD-Ant2-5580-PASS

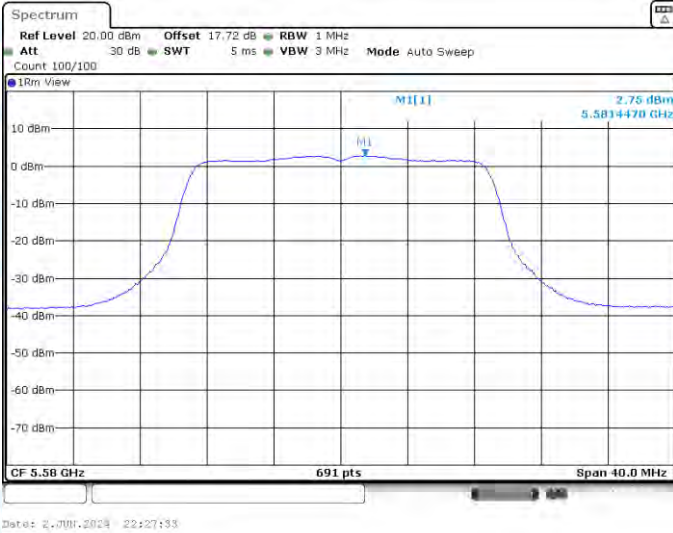


11AC20-CDD-Ant3-5580-PASS

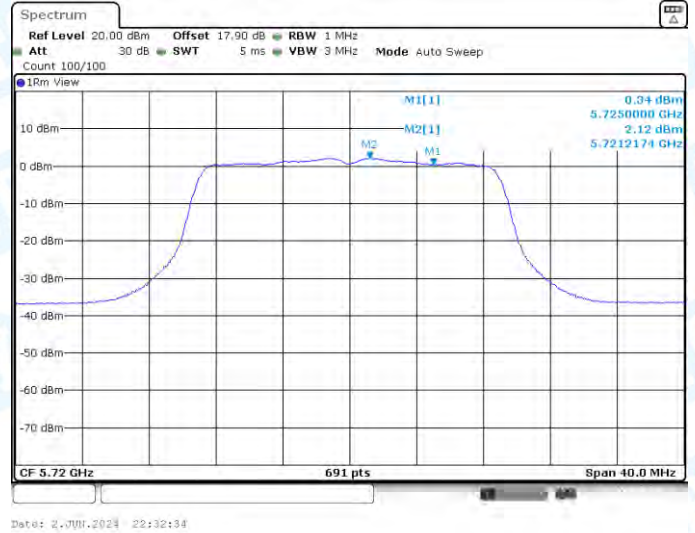


11AC20-CDD-Ant1-5720_UNII-2C-PASS

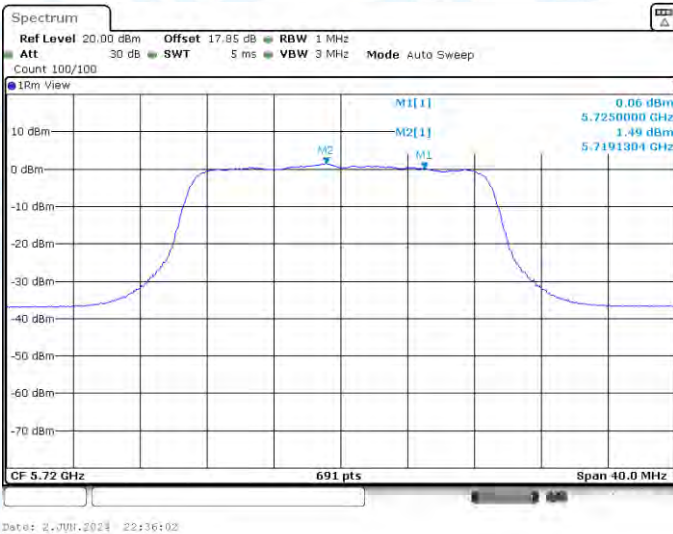


11AC20-CDD-Ant2-5720_UNII-2C-PASS

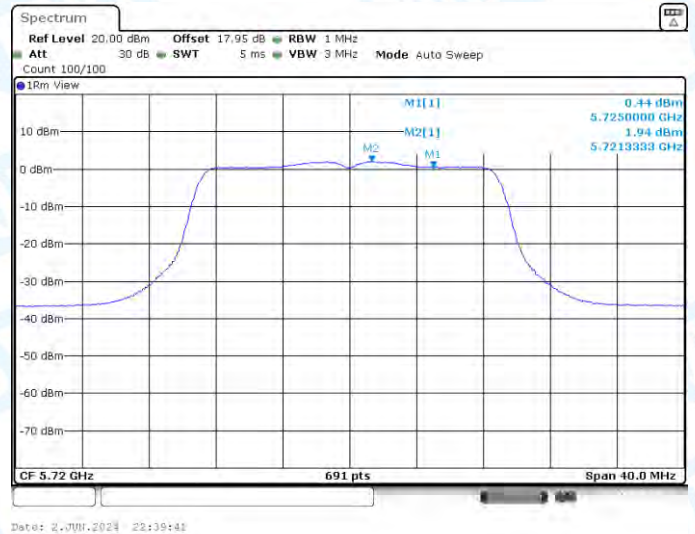


11AC20-CDD-Ant3-5720_UNII-2C-PASS

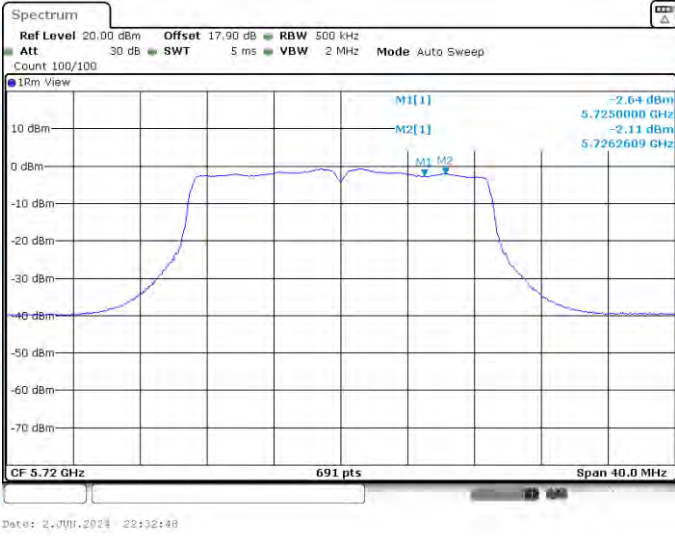

11AC20-CDD-Ant1-5720_UNII-3-PASS

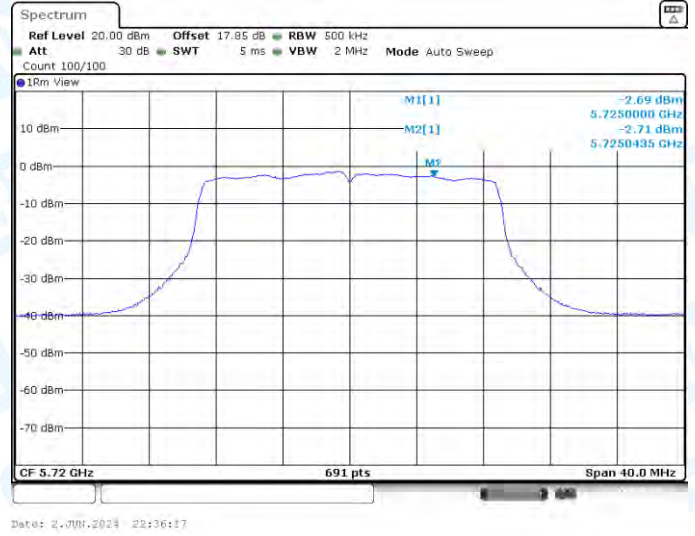

11AC20-CDD-Ant2-5720_UNII-3-PASS

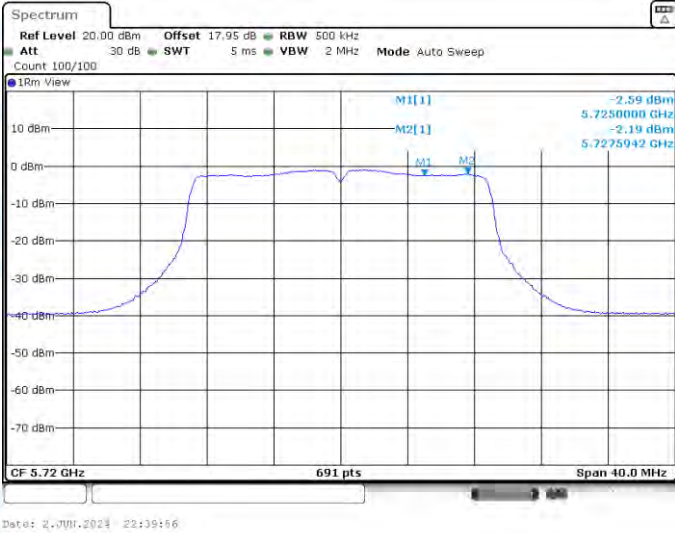

11AC20-CDD-Ant3-5720_UNII-3-PASS



11AC20-CDD-Ant1-5745-PASS



11AC20-CDD-Ant2-5745-PASS



11AC20-CDD-Ant3-5745-PASS



11AC20-CDD-Ant1-5785-PASS




11AC20-CDD-Ant2-5785-PASS




11AC20-CDD-Ant3-5785-PASS



11AC20-CDD-Ant1-5825-PASS

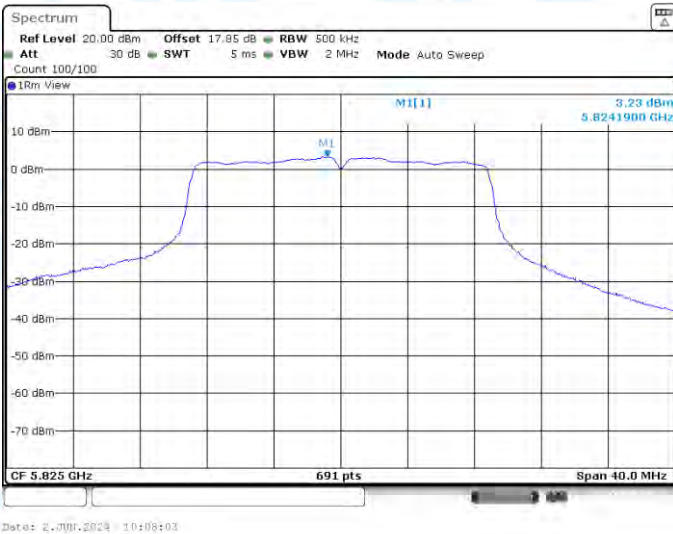


11AC20-CDD-Ant2-5825-PASS

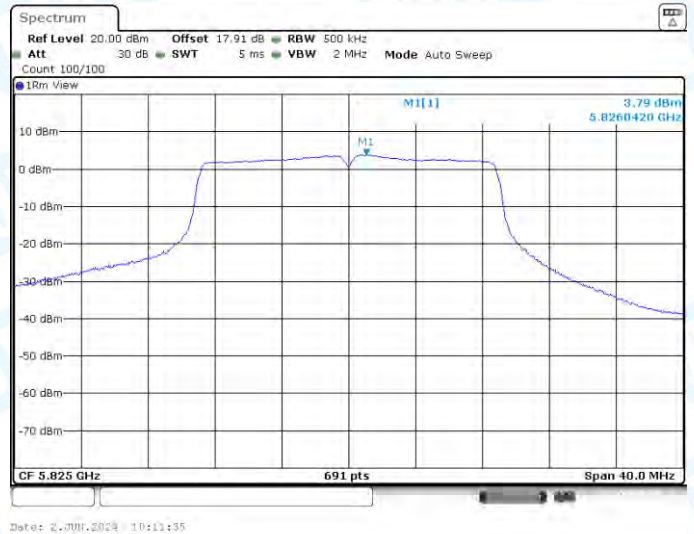

11AC20-CDD-Ant3-5825-PASS



11AC40-CDD-Ant1-5190-PASS

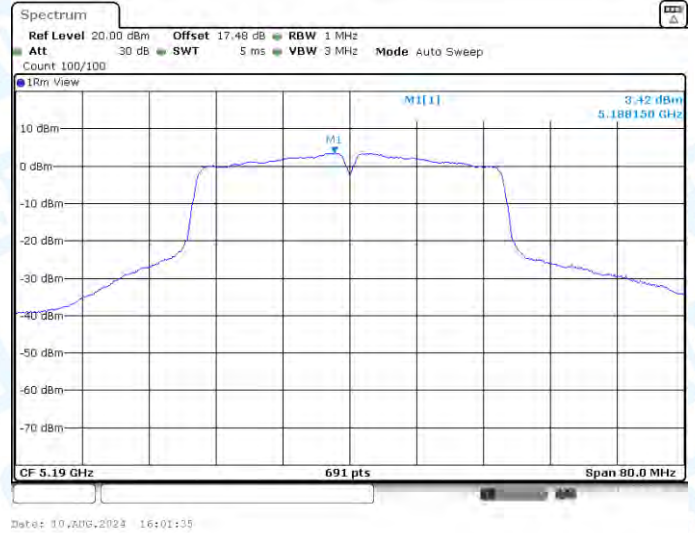


11AC40-CDD-Ant2-5190-PASS



11AC40-CDD-Ant3-5190-PASS



11AC40-CDD-Ant1-5230-PASS

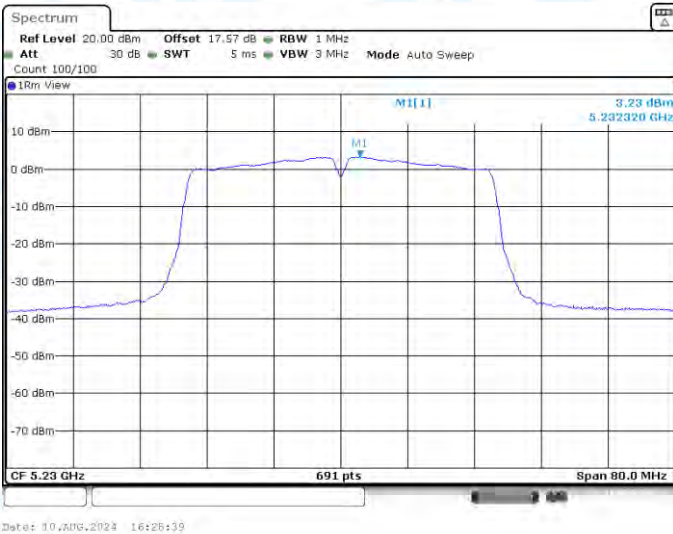


11AC40-CDD-Ant2-5230-PASS




11AC40-CDD-Ant3-5230-PASS




11AC40-CDD-Ant1-5270-PASS

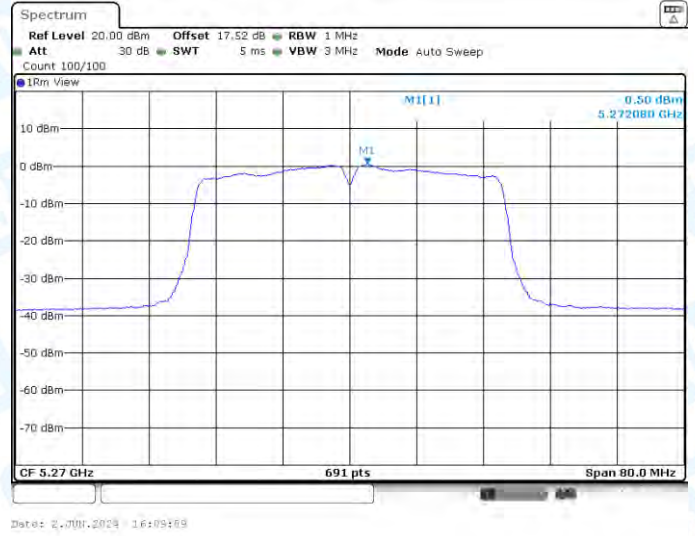

11AC40-CDD-Ant2-5270-PASS

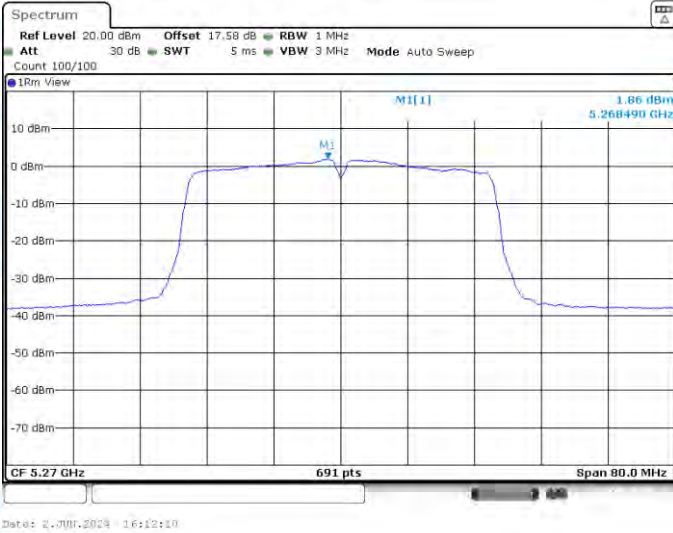

11AC40-CDD-Ant3-5270-PASS

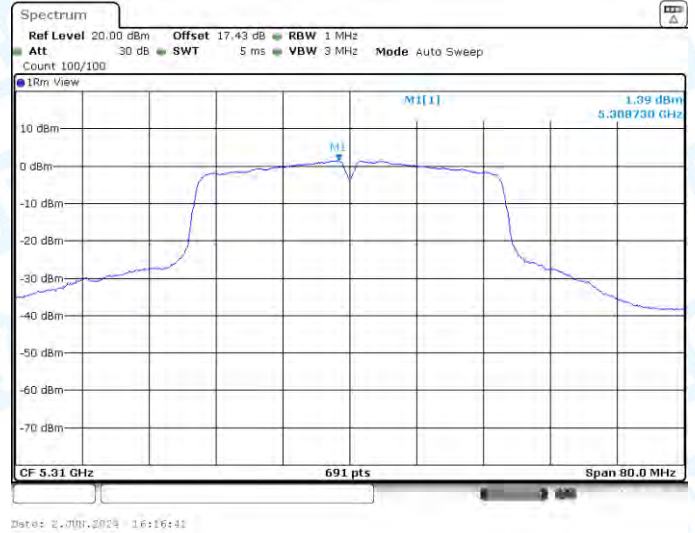

11AC40-CDD-Ant1-5310-PASS



11AC40-CDD-Ant2-5310-PASS



11AC40-CDD-Ant3-5310-PASS




11AC40-CDD-Ant1-5510-PASS




11AC40-CDD-Ant2-5510-PASS




11AC40-CDD-Ant3-5510-PASS

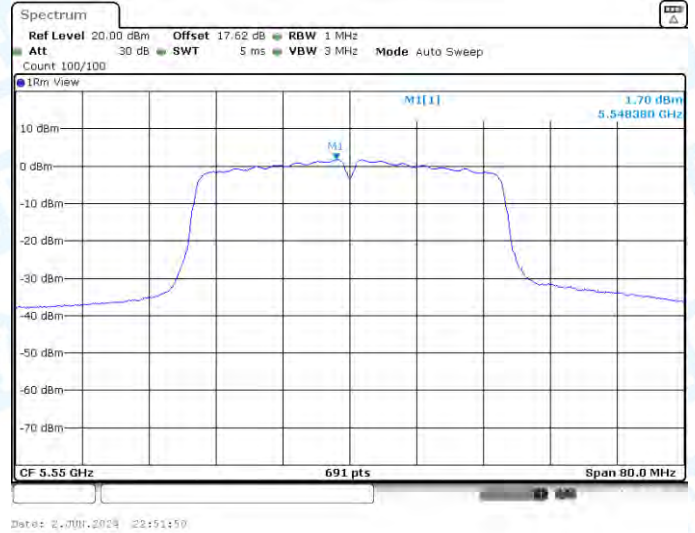


11AC40-CDD-Ant1-5550-PASS

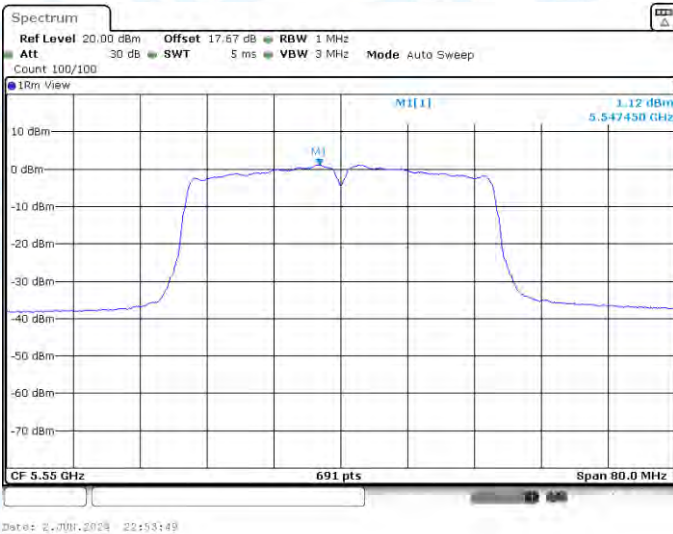


11AC40-CDD-Ant2-5550-PASS

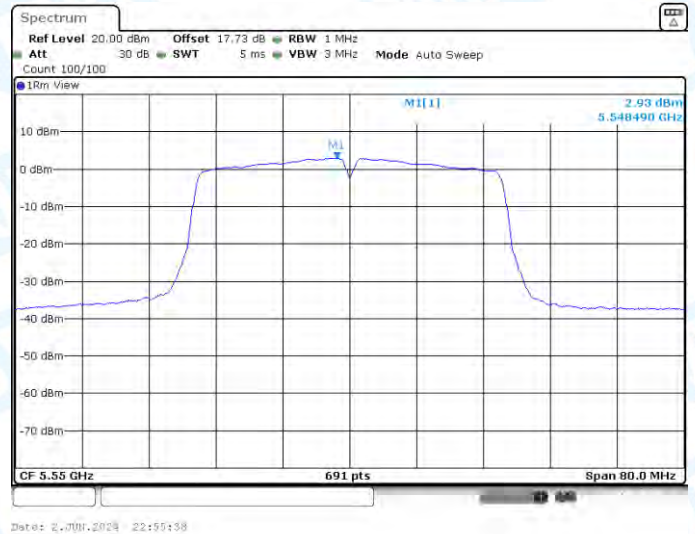


11AC40-CDD-Ant3-5550-PASS

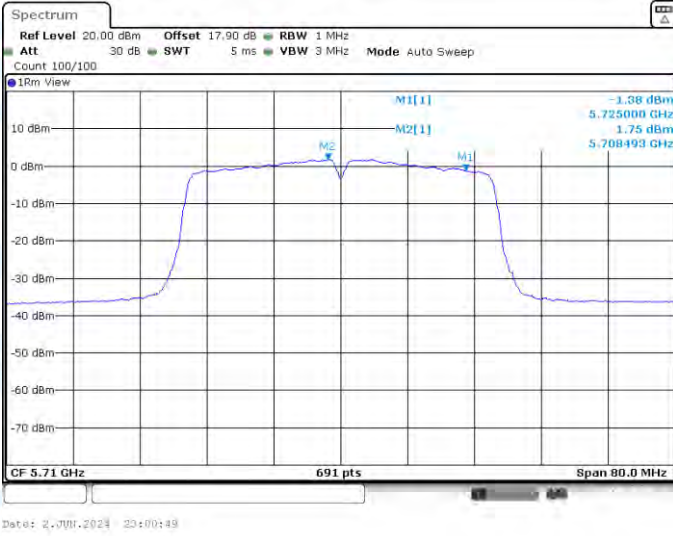


11AC40-CDD-Ant1-5710_UNII-2C-PASS

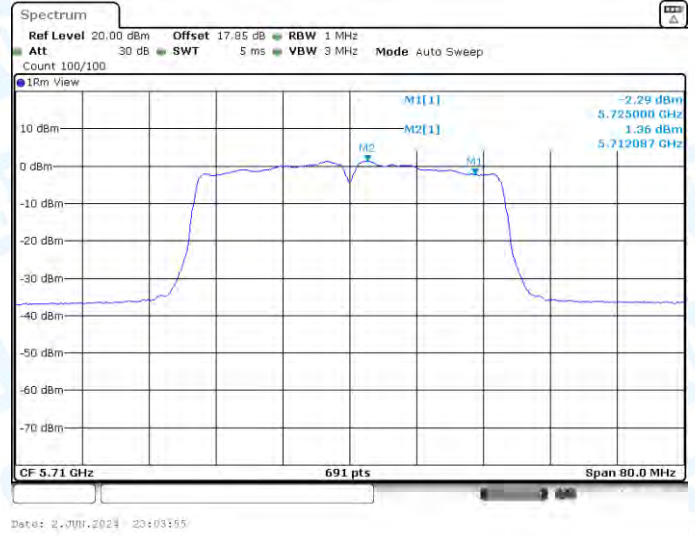


11AC40-CDD-Ant2-5710_UNII-2C-PASS

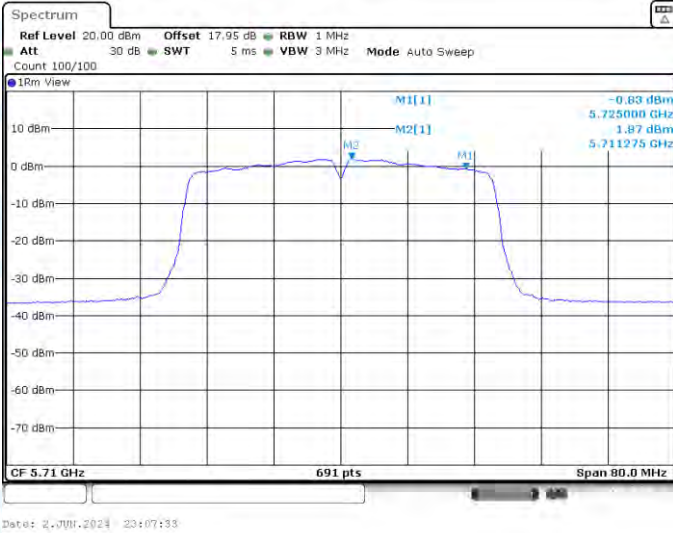


11AC40-CDD-Ant3-5710_UNII-2C-PASS

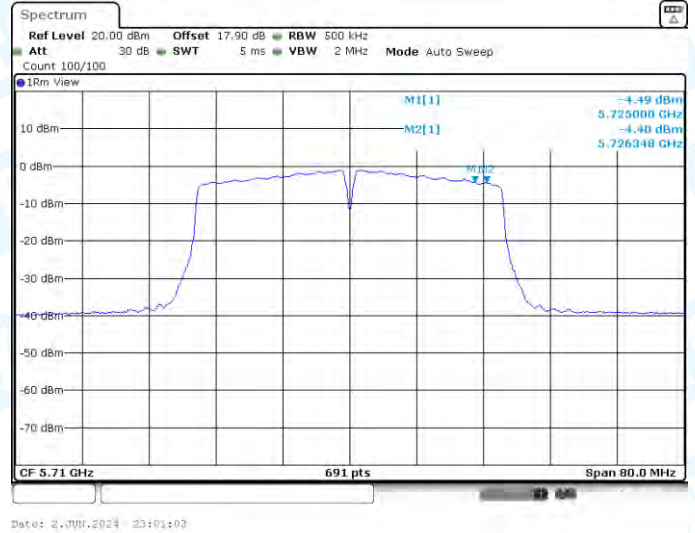

11AC40-CDD-Ant1-5710_UNII-3-PASS

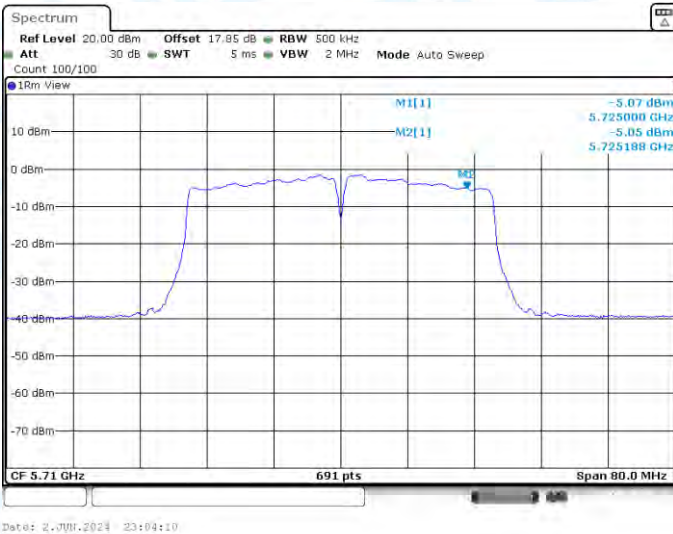

11AC40-CDD-Ant2-5710_UNII-3-PASS

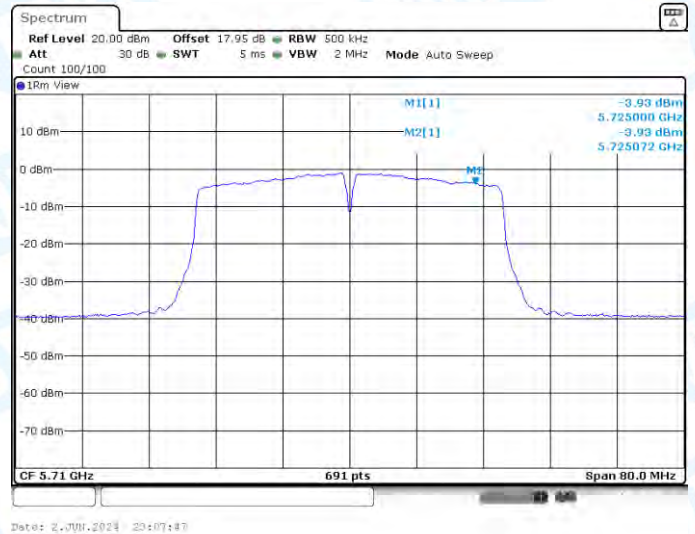


11AC40-CDD-Ant3-5710_UNII-3-PASS



11AC40-CDD-Ant1-5755-PASS




11AC40-CDD-Ant2-5755-PASS

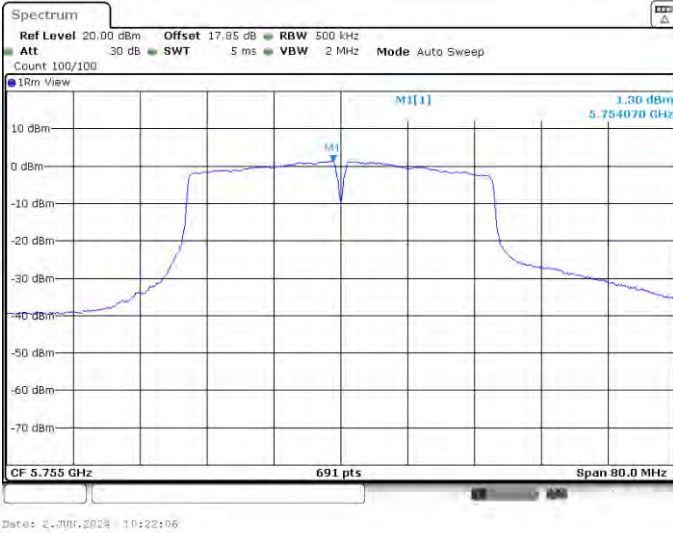

11AC40-CDD-Ant3-5755-PASS



11AC40-CDD-Ant1-5795-PASS

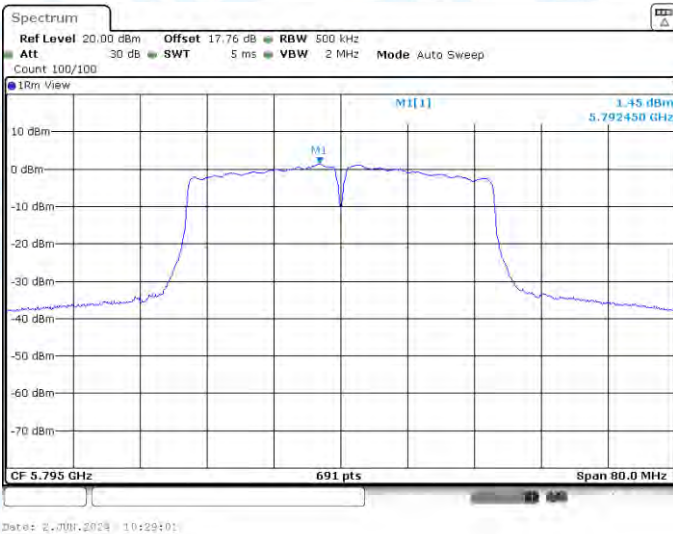

11AC40-CDD-Ant2-5795-PASS



11AC40-CDD-Ant3-5795-PASS



11AC80-CDD-Ant1-5210-PASS



11AC80-CDD-Ant2-5210-PASS




11AC80-CDD-Ant3-5210-PASS



11AC80-CDD-Ant1-5290-PASS



11AC80-CDD-Ant2-5290-PASS

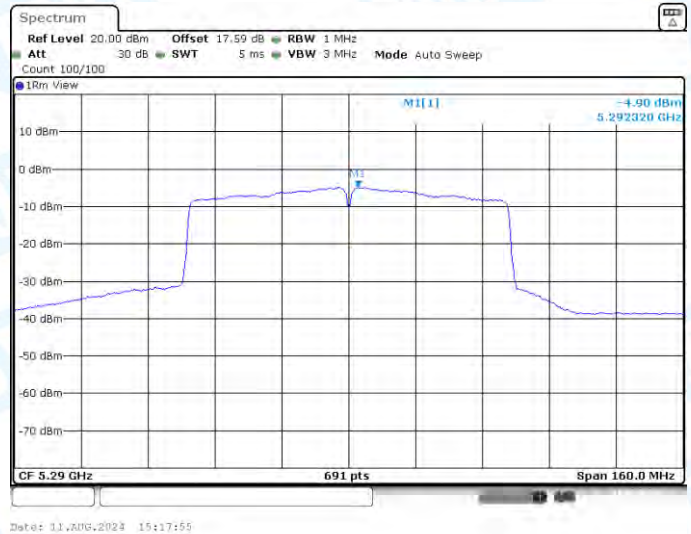

11AC80-CDD-Ant3-5290-PASS




11AC80-CDD-Ant1-5530-PASS



11AC80-CDD-Ant2-5530-PASS




11AC80-CDD-Ant3-5530-PASS

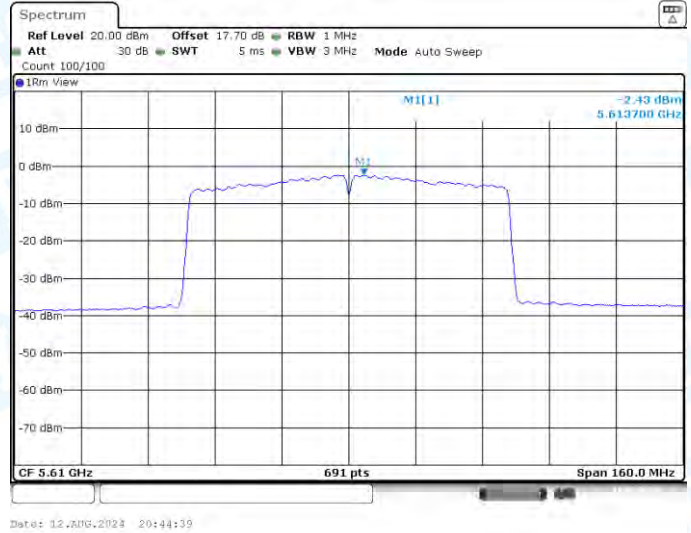



11AC80-CDD-Ant1-5610-PASS



11AC80-CDD-Ant2-5610-PASS

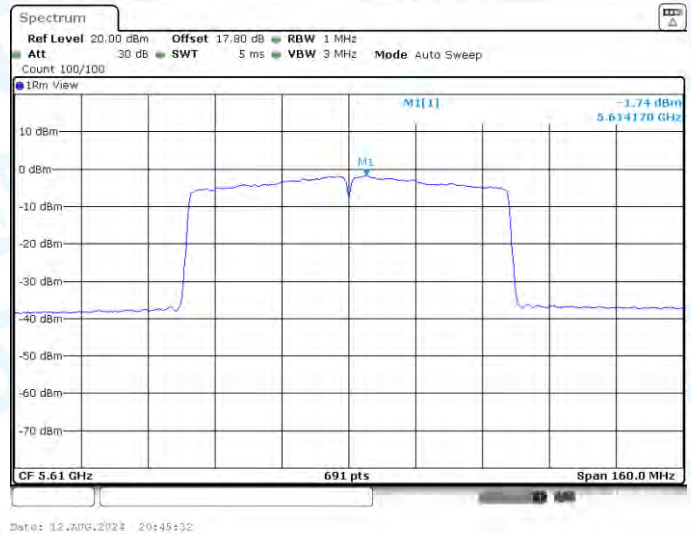


11AC80-CDD-Ant3-5610-PASS

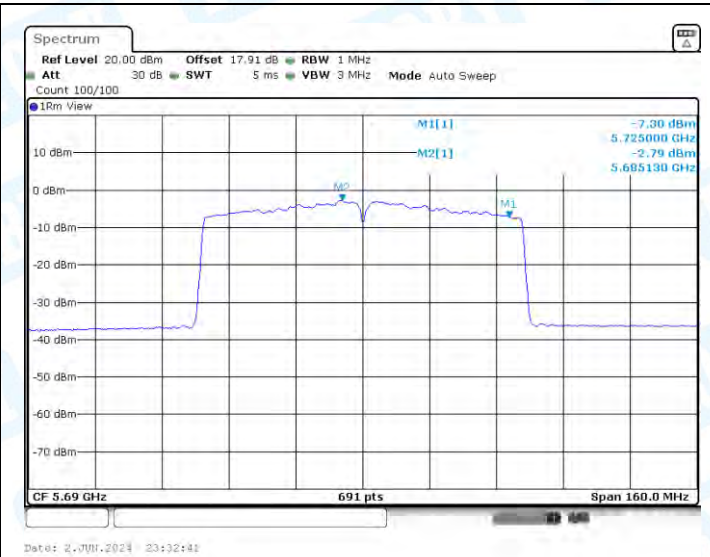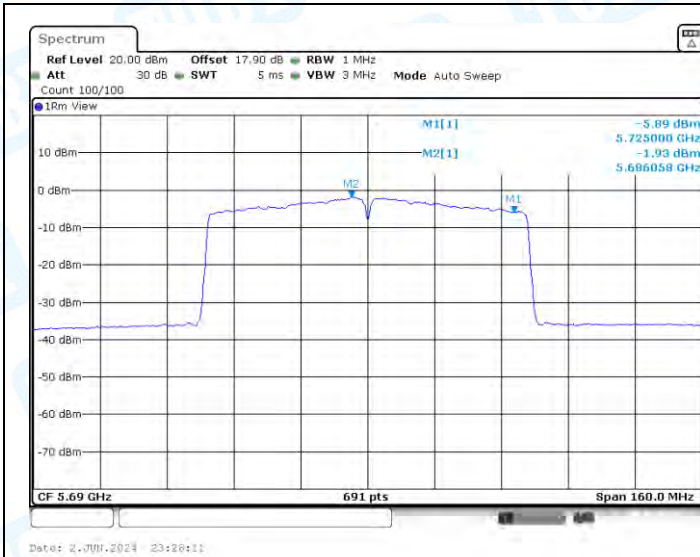



11AC80-CDD-Ant1-5690_UNII-2C-PASS

11AC80-CDD-Ant2-5690_UNII-2C-PASS

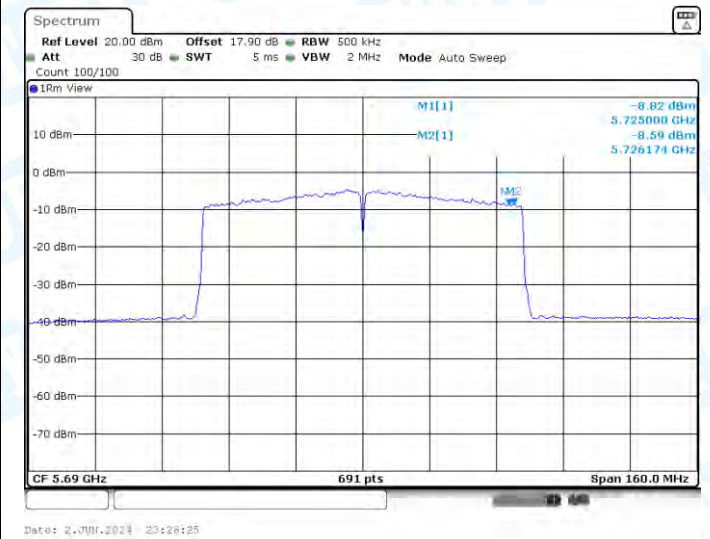

11AC80-CDD-Ant3-5690_UNII-2C-PASS

11AC80-CDD-Ant1-5690_UNII-3-PASS

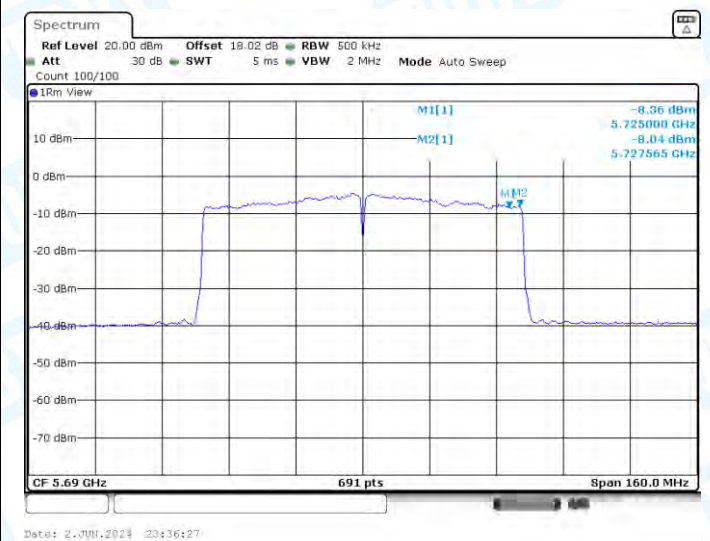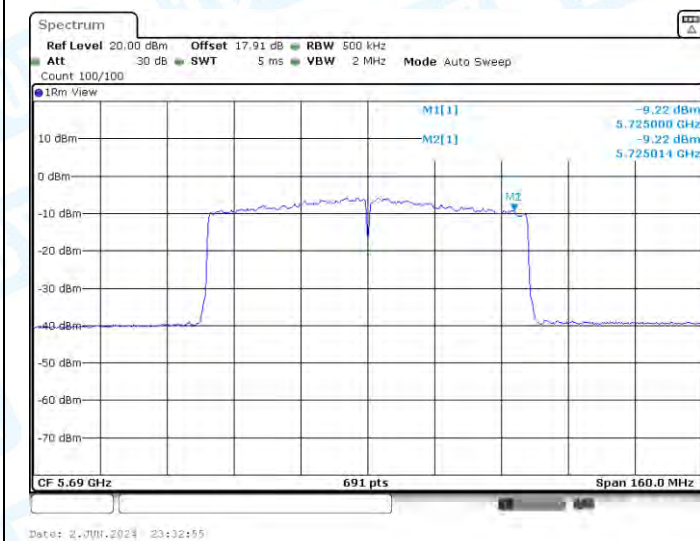

11AC80-CDD-Ant2-5690_UNII-3-PASS

11AC80-CDD-Ant3-5690_UNII-3-PASS




11AC80-CDD-Ant1-5775-PASS




11AC80-CDD-Ant2-5775-PASS




11AC80-CDD-Ant3-5775-PASS

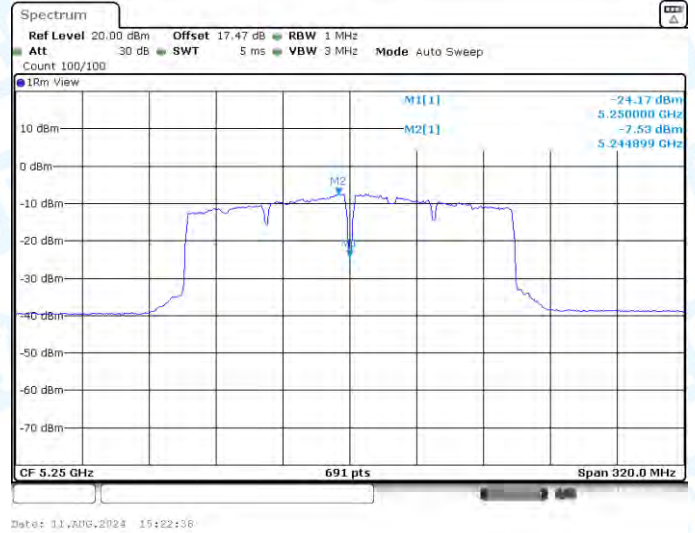


11AC160-CDD-Ant1-5250_UNII-1-PASS

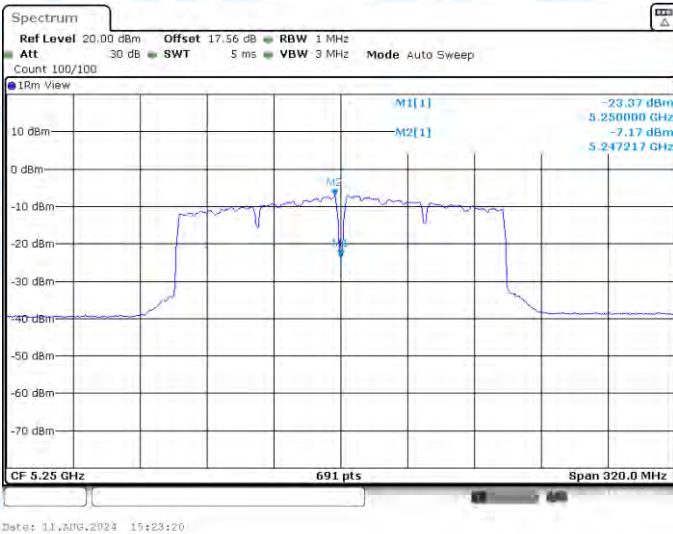


11AC160-CDD-Ant2-5250_UNII-1-PASS

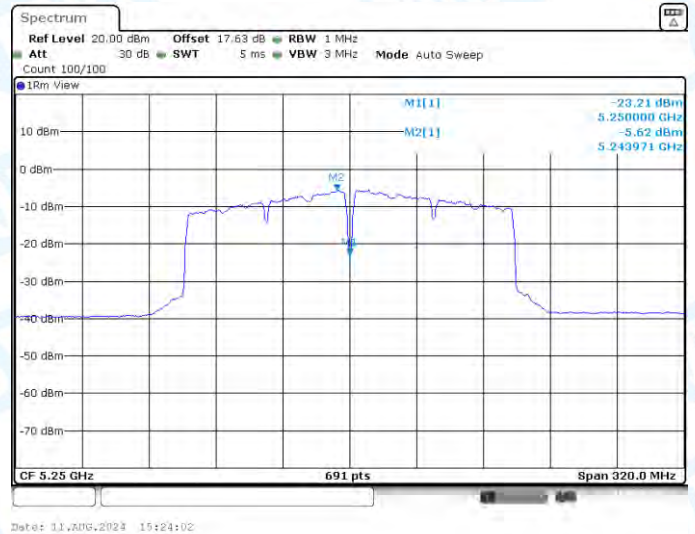

11AC160-CDD-Ant3-5250_UNII-1-PASS

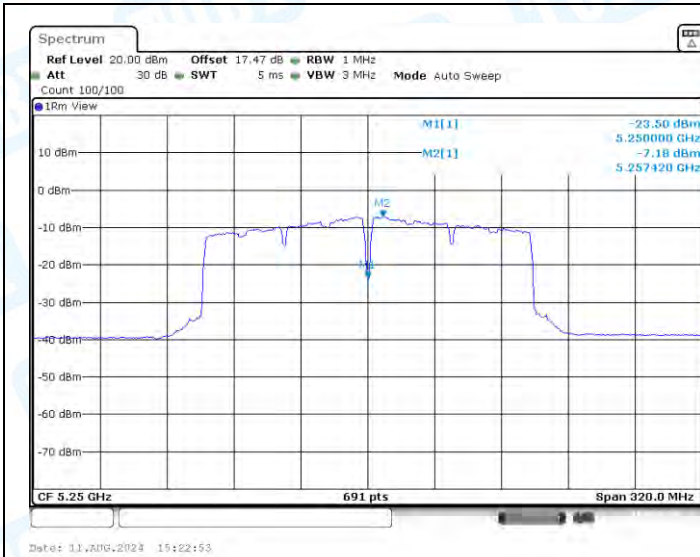


11AC160-CDD-Ant1-5250_UNII-2A-PASS

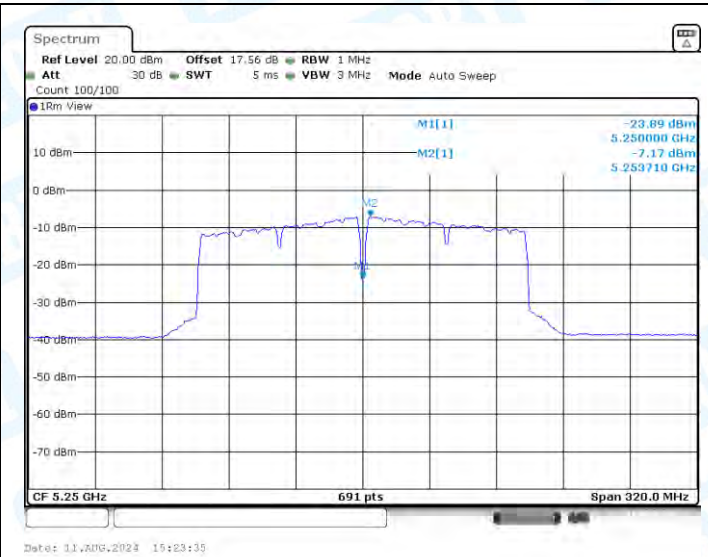

11AC160-CDD-Ant2-5250_UNII-2A-PASS




11AC160-CDD-Ant3-5250_UNII-2A-PASS

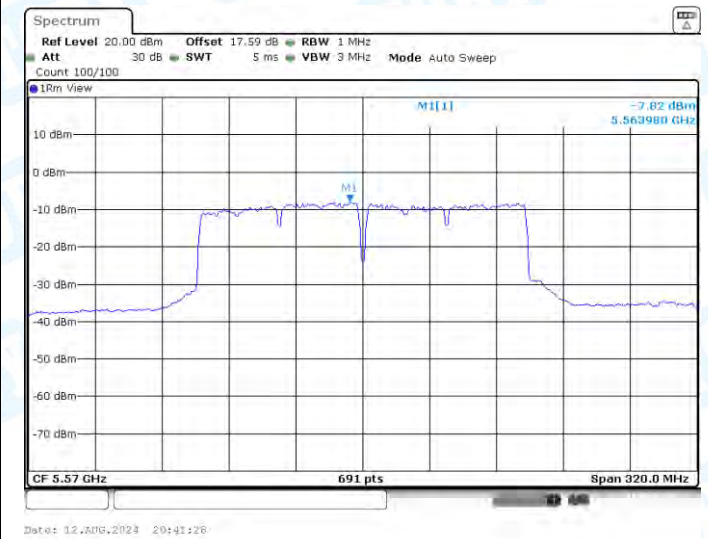

11AC160-CDD-Ant1-5570-PASS



11AC160-CDD-Ant2-5570-PASS

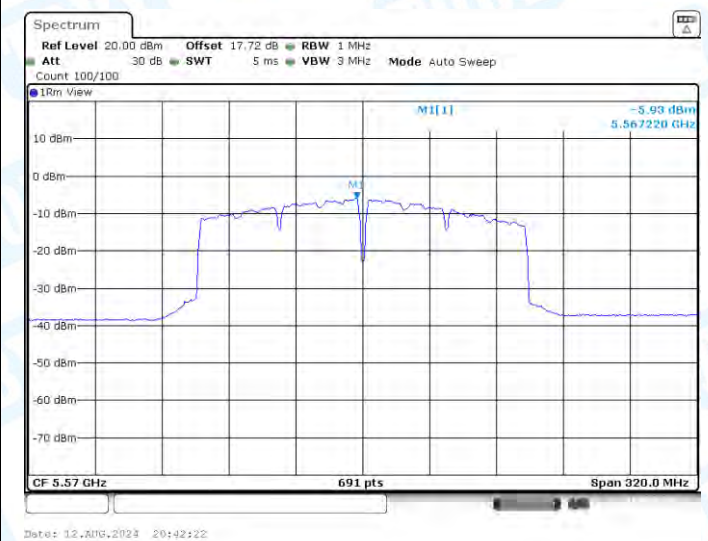

11AC160-CDD-Ant3-5570-PASS



11AX20-CDD-Ant1-5180-PASS



11AX20-CDD-Ant2-5180-PASS



11AX20-CDD-Ant3-5180-PASS



11AX20-CDD-Ant1-5200-PASS



11AX20-CDD-Ant2-5200-PASS



11AX20-CDD-Ant3-5200-PASS




11AX20-CDD-Ant1-5240-PASS



11AX20-CDD-Ant2-5240-PASS




11AX20-CDD-Ant3-5240-PASS

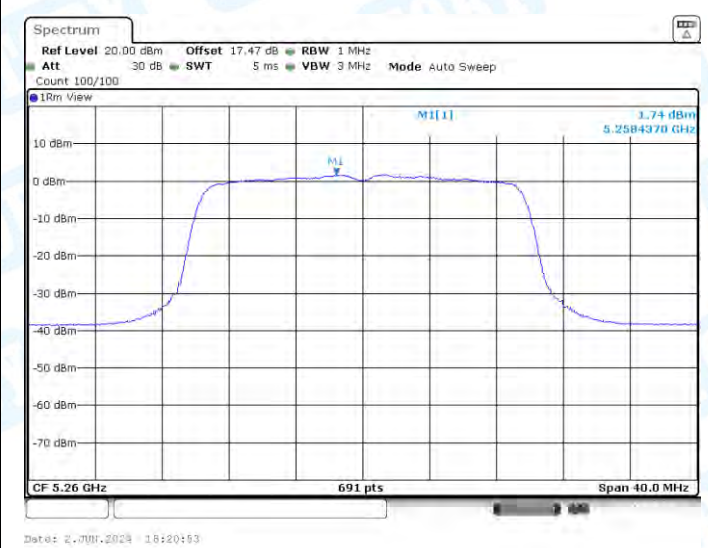

11AX20-CDD-Ant1-5260-PASS



11AX20-CDD-Ant2-5260-PASS

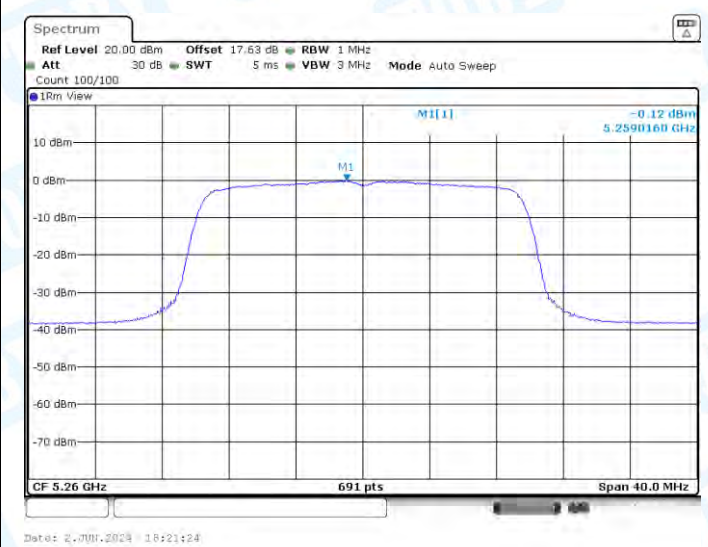

11AX20-CDD-Ant3-5260-PASS




11AX20-CDD-Ant1-5280-PASS



11AX20-CDD-Ant2-5280-PASS



11AX20-CDD-Ant3-5280-PASS

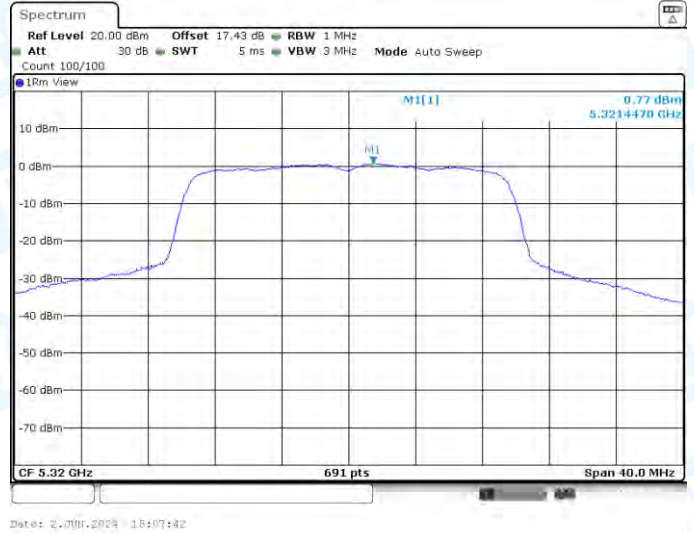


11AX20-CDD-Ant1-5320-PASS




11AX20-CDD-Ant2-5320-PASS




11AX20-CDD-Ant3-5320-PASS

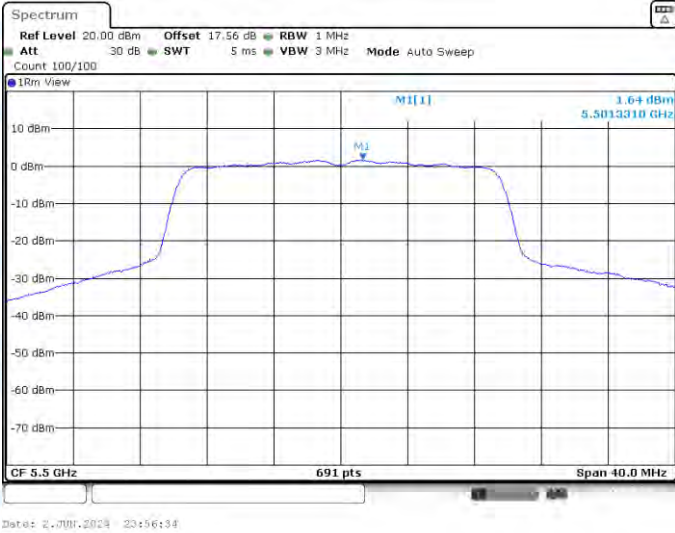

11AX20-CDD-Ant1-5500-PASS

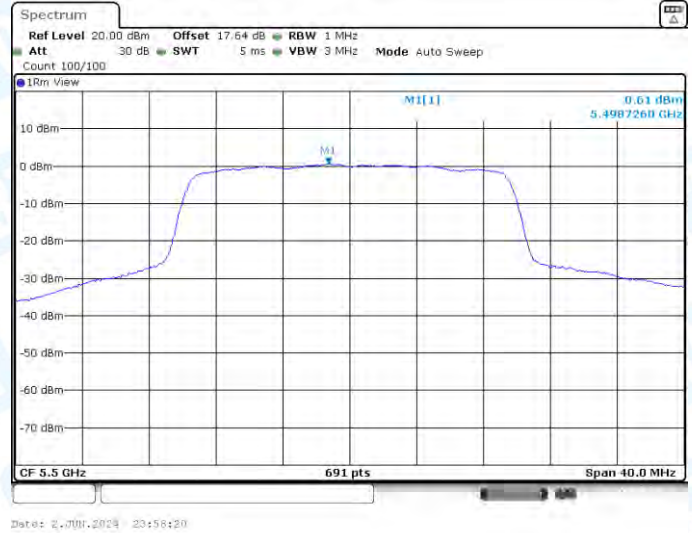

11AX20-CDD-Ant2-5500-PASS

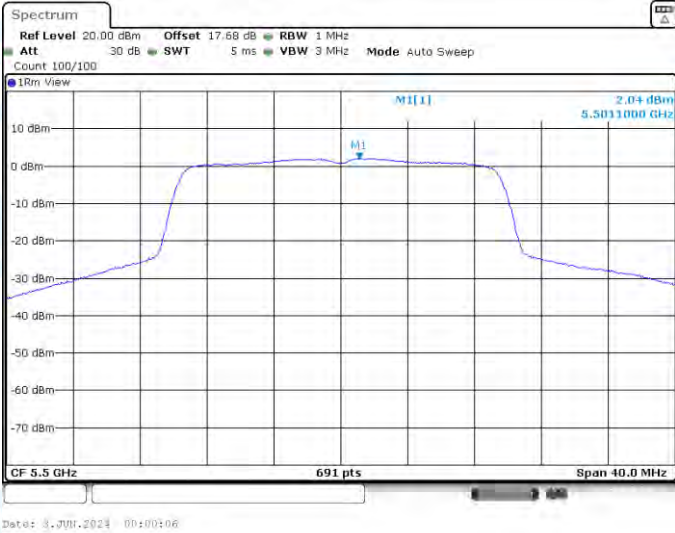

11AX20-CDD-Ant3-5500-PASS




11AX20-CDD-Ant1-5580-PASS




11AX20-CDD-Ant2-5580-PASS




11AX20-CDD-Ant3-5580-PASS

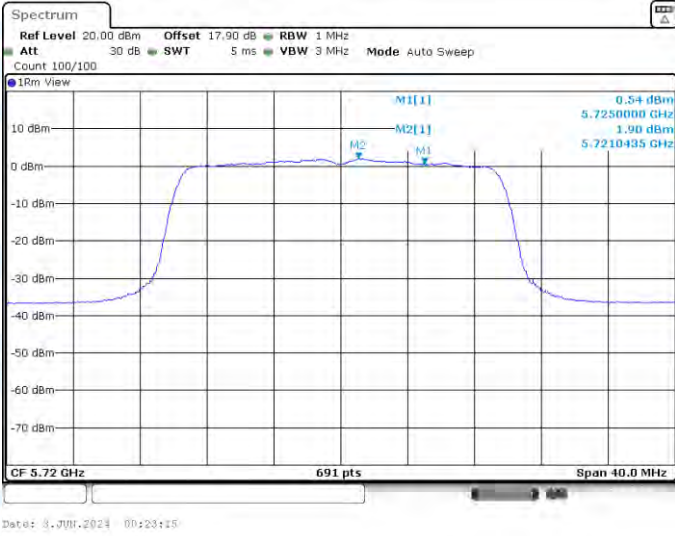


11AX20-CDD-Ant1-5720_UNII-2C-PASS

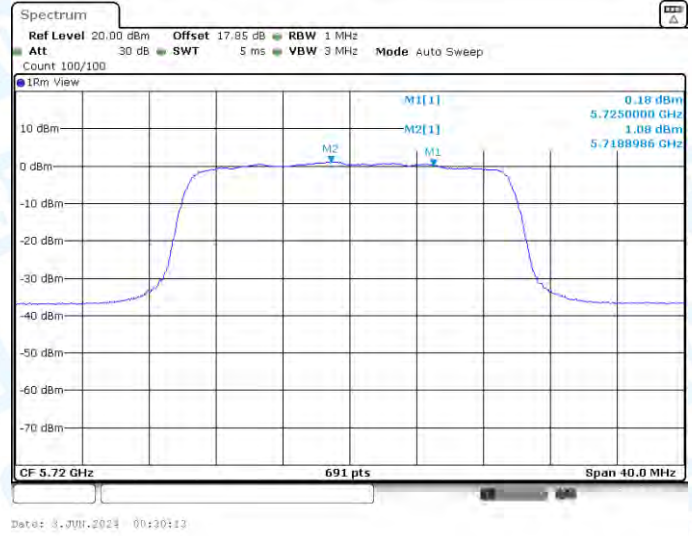


11AX20-CDD-Ant2-5720_UNII-2C-PASS

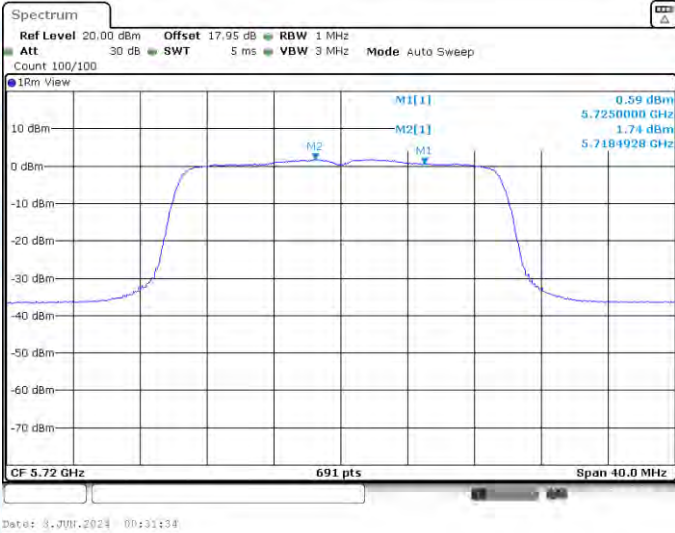


11AX20-CDD-Ant3-5720_UNII-2C-PASS

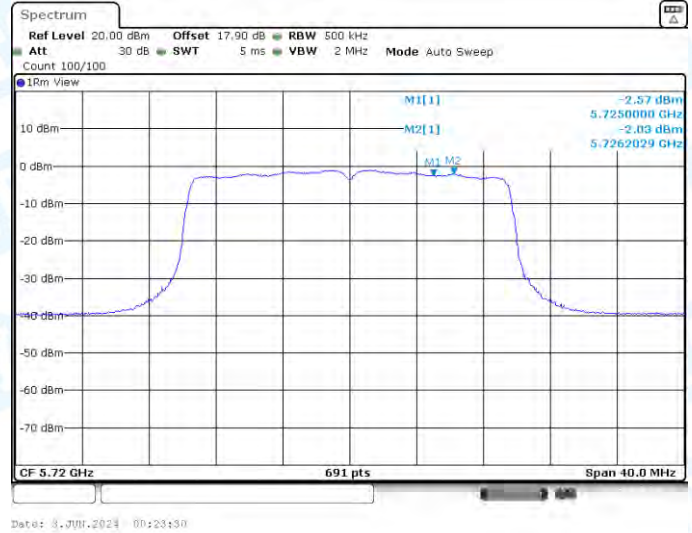

11AX20-CDD-Ant1-5720_UNII-3-PASS

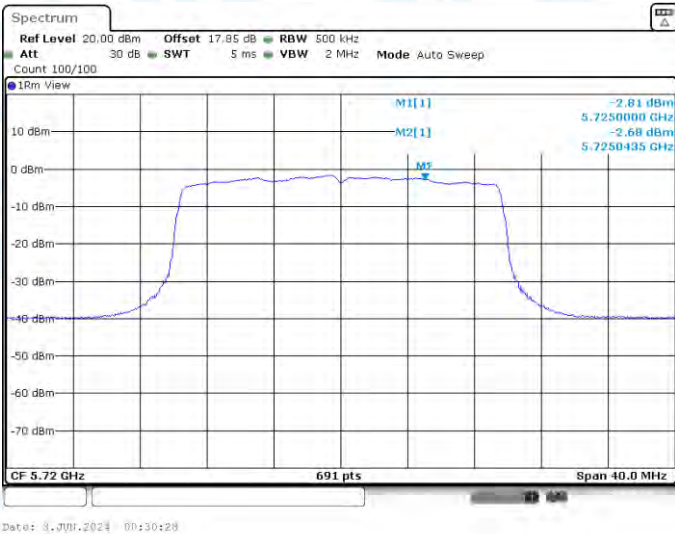

11AX20-CDD-Ant2-5720_UNII-3-PASS

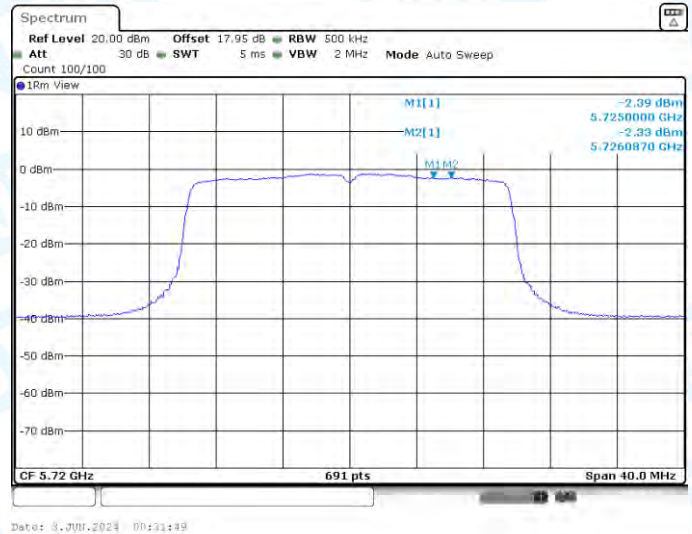

11AX20-CDD-Ant3-5720_UNII-3-PASS



11AX20-CDD-Ant1-5745-PASS




11AX20-CDD-Ant2-5745-PASS



11AX20-CDD-Ant3-5745-PASS



11AX20-CDD-Ant1-5785-PASS

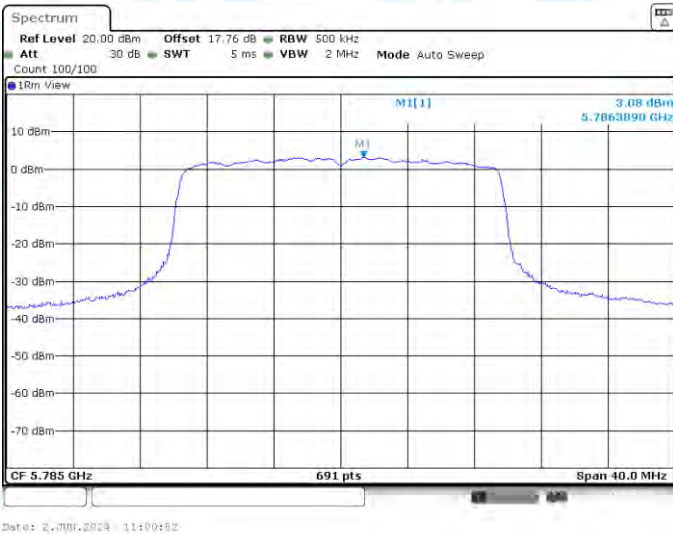


11AX20-CDD-Ant2-5785-PASS




11AX20-CDD-Ant3-5785-PASS




11AX20-CDD-Ant1-5825-PASS

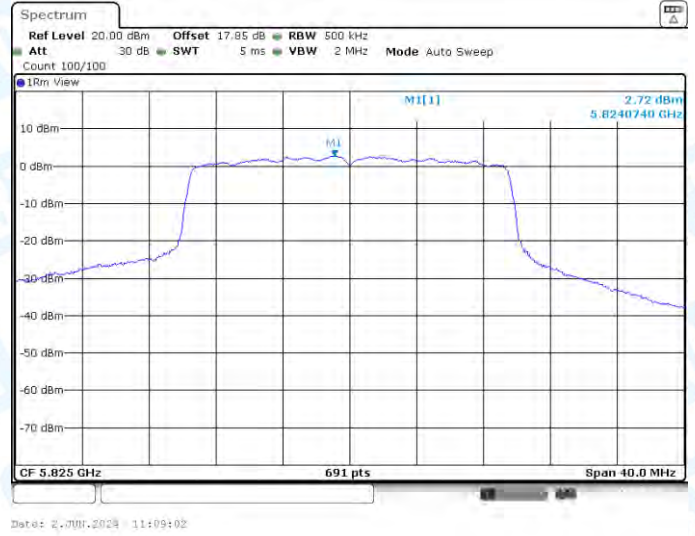

11AX20-CDD-Ant2-5825-PASS

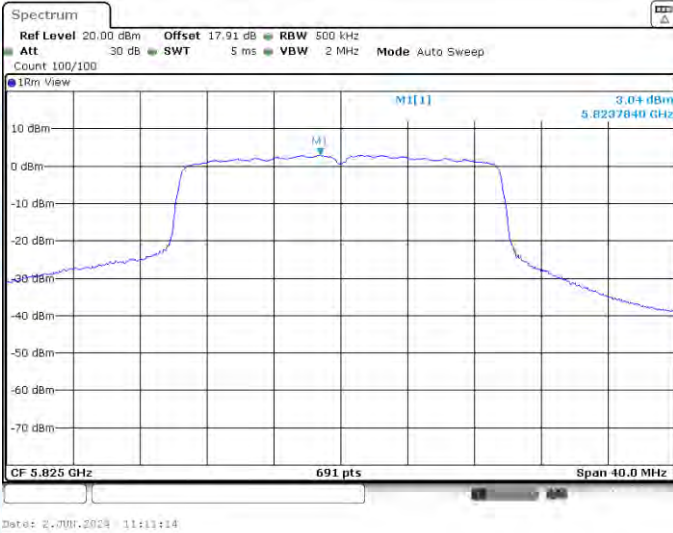

11AX20-CDD-Ant3-5825-PASS

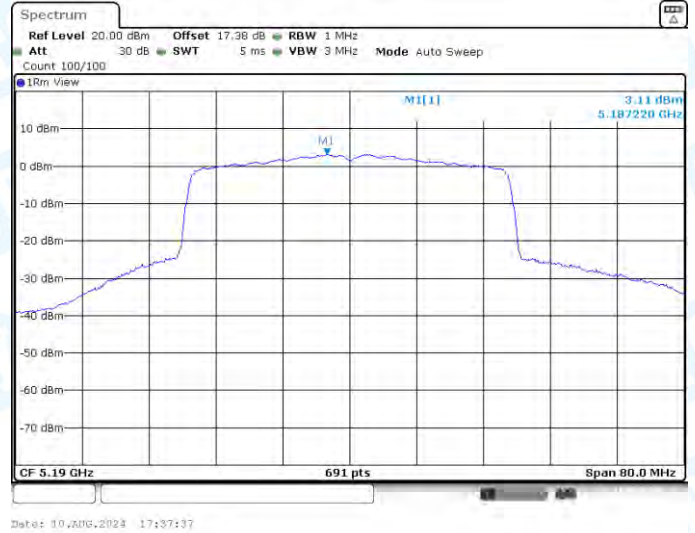


11AX40-CDD-Ant1-5190-PASS




11AX40-CDD-Ant2-5190-PASS




11AX40-CDD-Ant3-5190-PASS

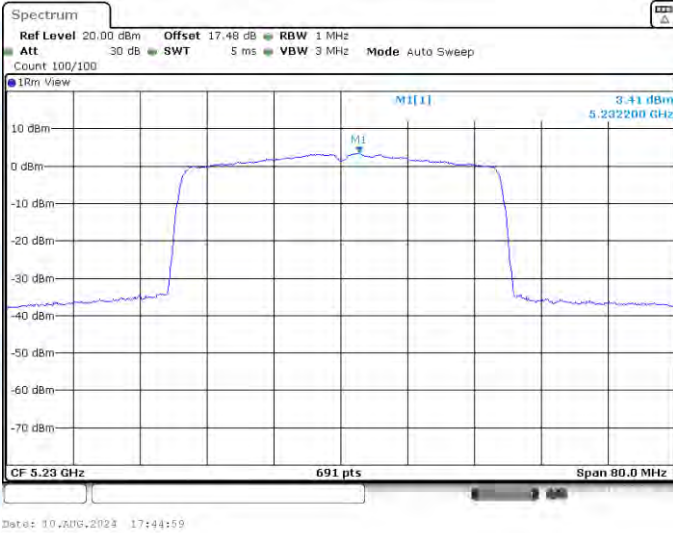


11AX40-CDD-Ant1-5230-PASS

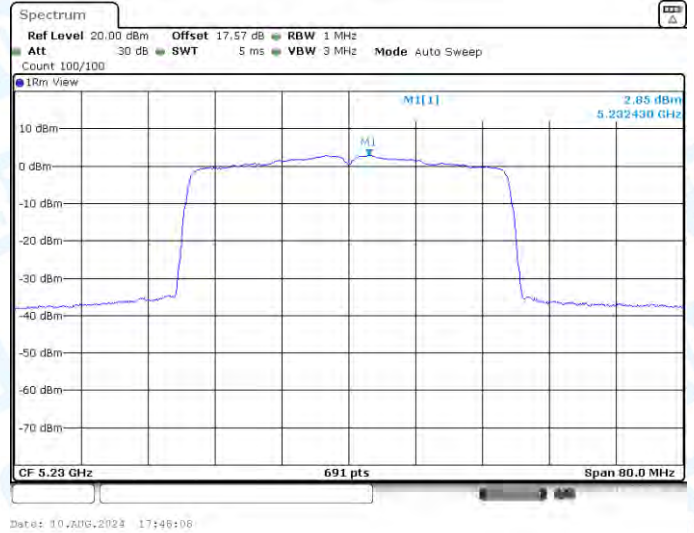


11AX40-CDD-Ant2-5230-PASS

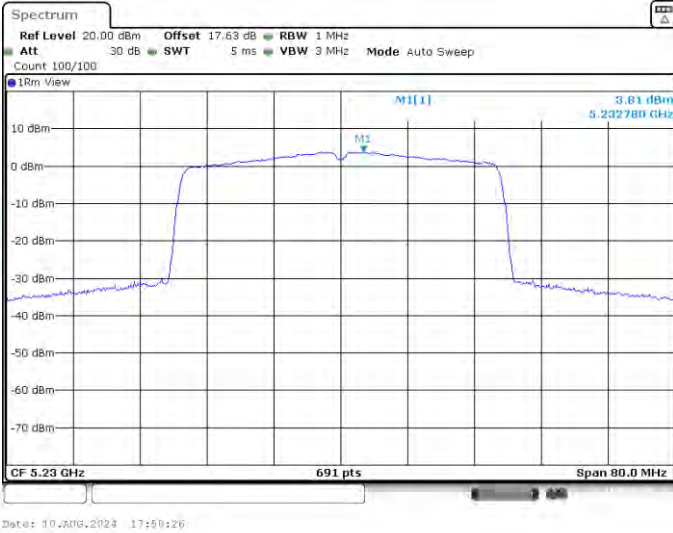


11AX40-CDD-Ant3-5230-PASS

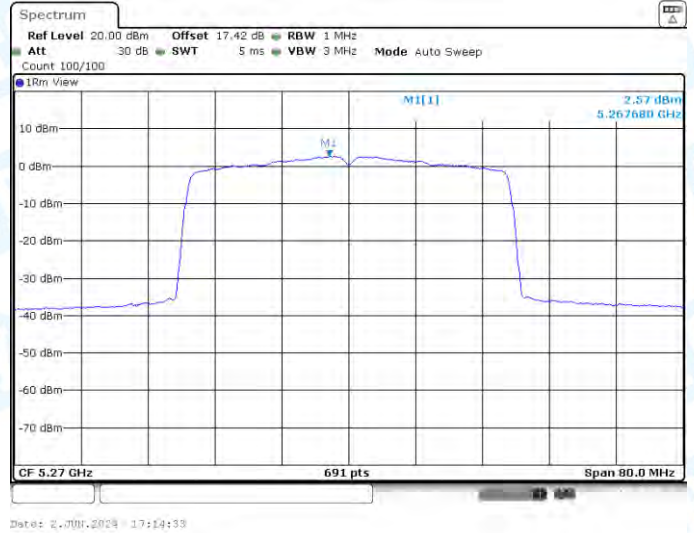


11AX40-CDD-Ant1-5270-PASS

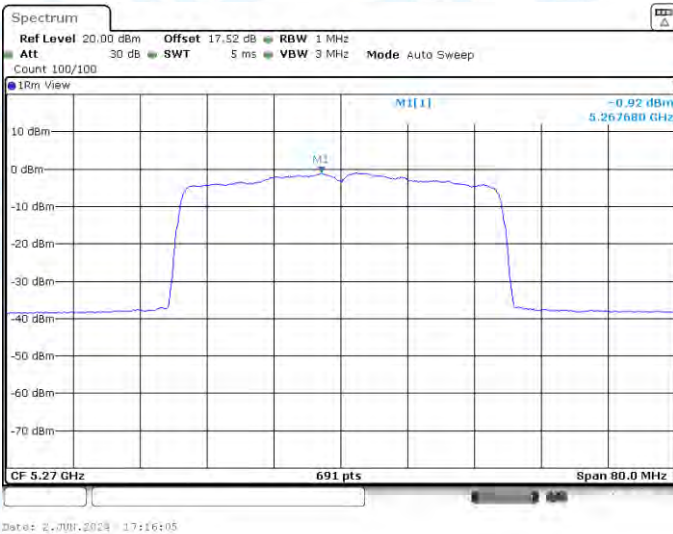

11AX40-CDD-Ant2-5270-PASS

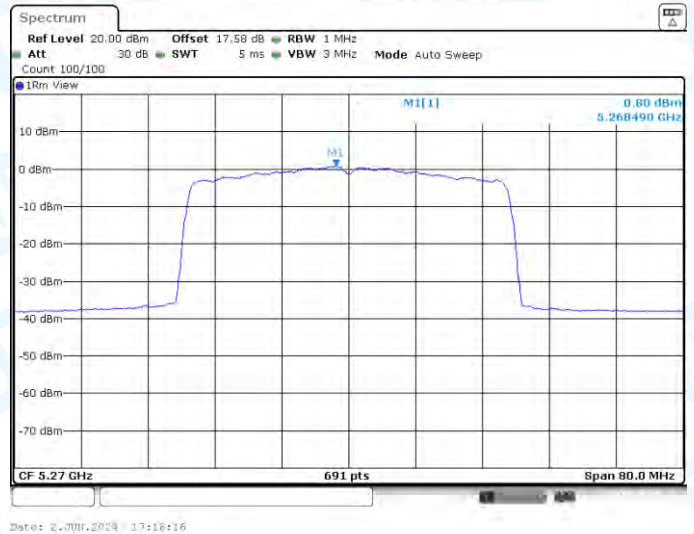


11AX40-CDD-Ant3-5270-PASS

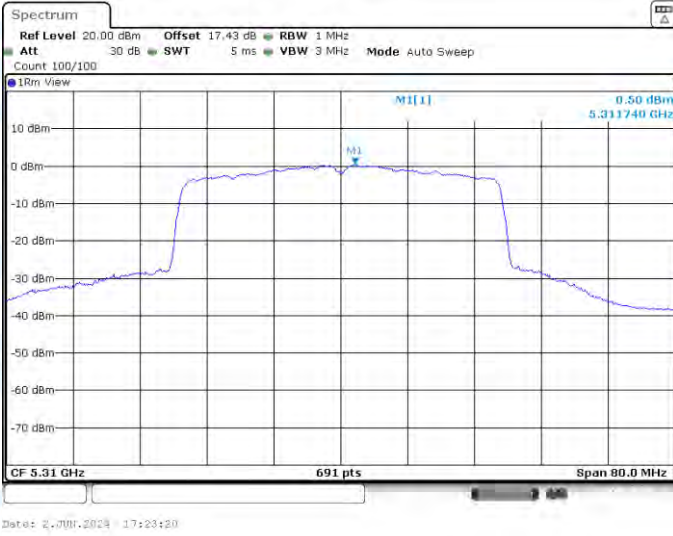

11AX40-CDD-Ant1-5310-PASS




11AX40-CDD-Ant2-5310-PASS

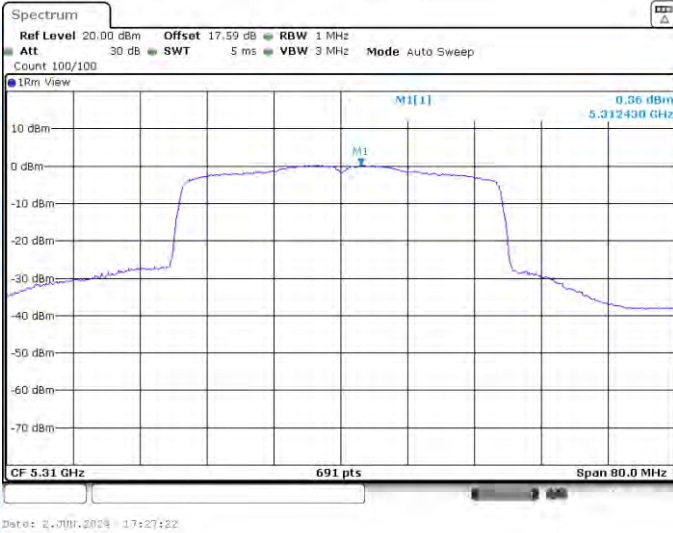

11AX40-CDD-Ant3-5310-PASS




11AX40-CDD-Ant1-5510-PASS

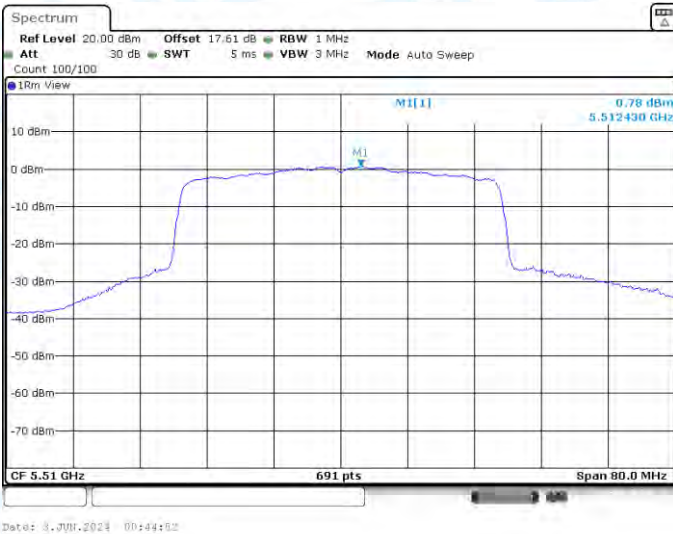


11AX40-CDD-Ant2-5510-PASS




11AX40-CDD-Ant3-5510-PASS

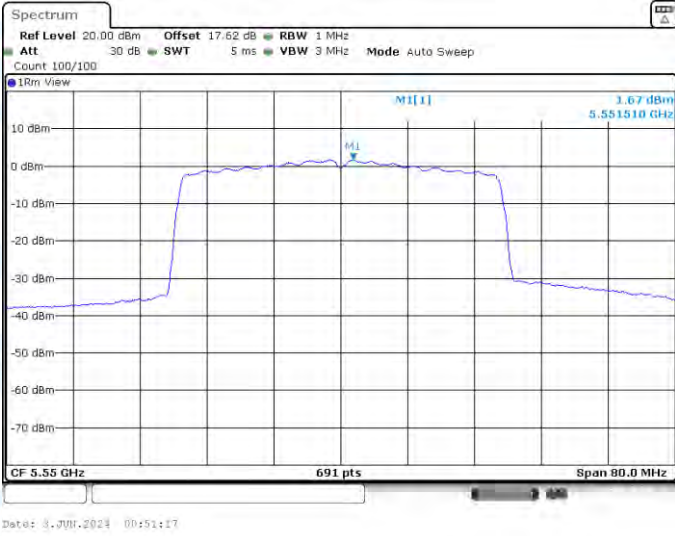


11AX40-CDD-Ant1-5550-PASS

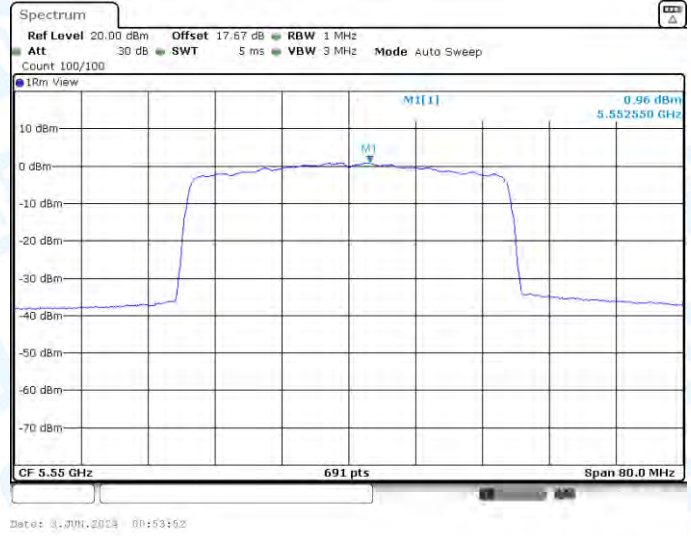


11AX40-CDD-Ant2-5550-PASS

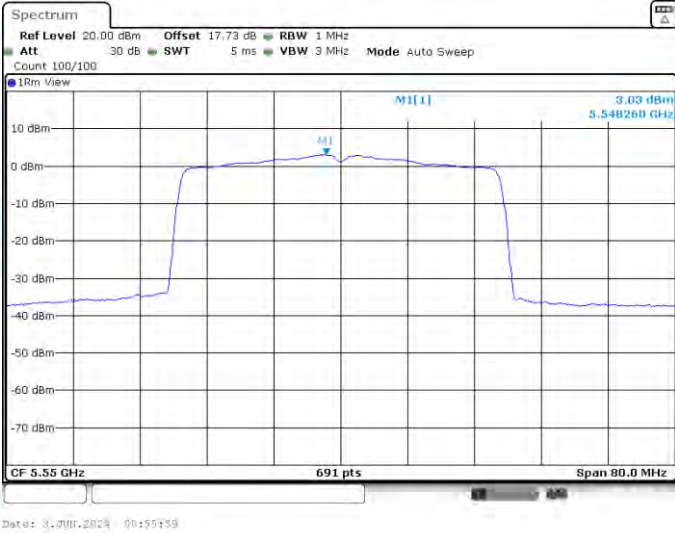


11AX40-CDD-Ant3-5550-PASS

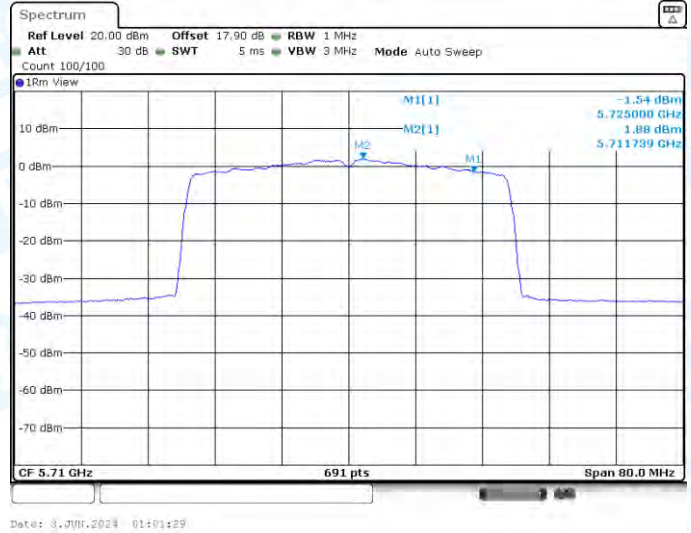


11AX40-CDD-Ant1-5710_UNII-2C-PASS

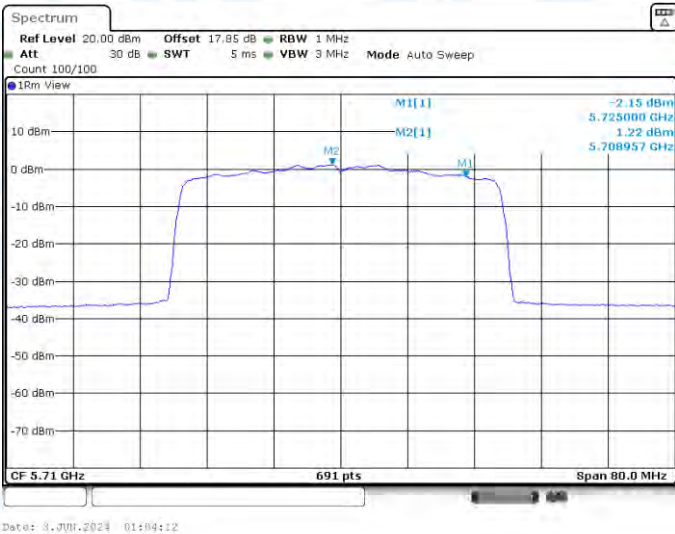

11AX40-CDD-Ant2-5710_UNII-2C-PASS

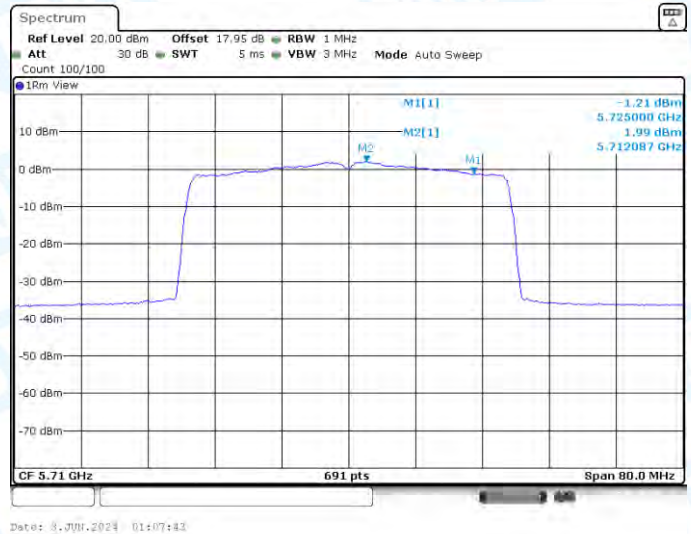

11AX40-CDD-Ant3-5710_UNII-2C-PASS

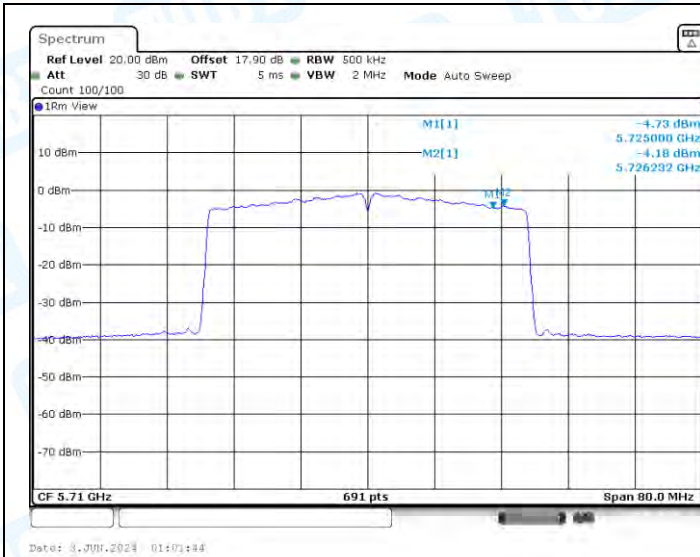

11AX40-CDD-Ant1-5710_UNII-3-PASS

11AX40-CDD-Ant2-5710_UNII-3-PASS



11AX40-CDD-Ant3-5710_UNII-3-PASS

11AX40-CDD-Ant1-5755-PASS




11AX40-CDD-Ant2-5755-PASS

11AX40-CDD-Ant3-5755-PASS



11AX40-CDD-Ant1-5795-PASS

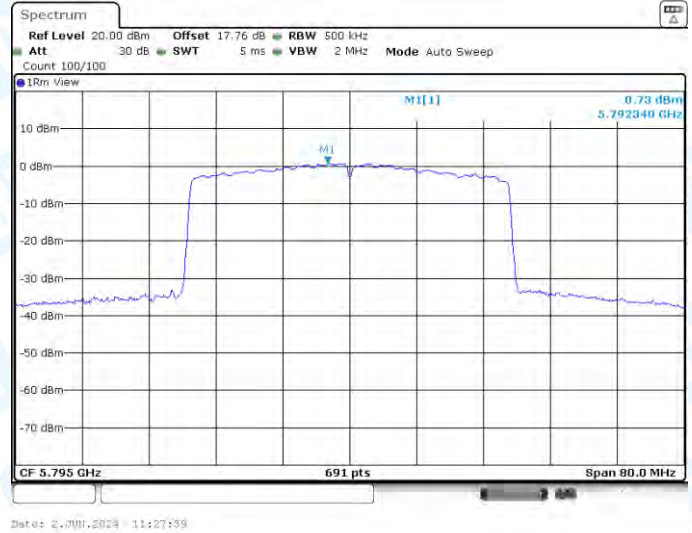


11AX40-CDD-Ant2-5795-PASS




11AX40-CDD-Ant3-5795-PASS



11AX80-CDD-Ant1-5210-PASS

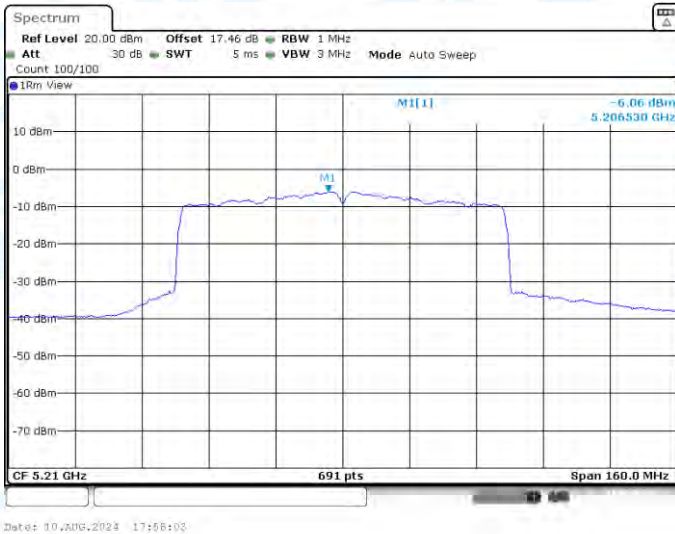

11AX80-CDD-Ant2-5210-PASS

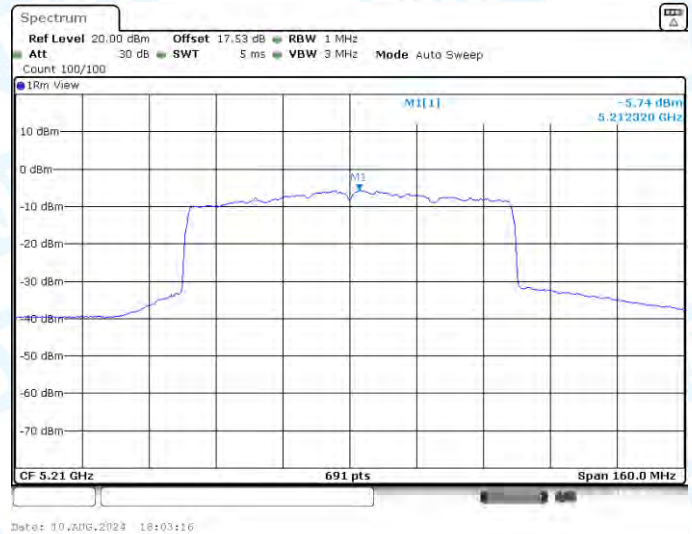

11AX80-CDD-Ant3-5210-PASS



11AX80-CDD-Ant1-5290-PASS



11AX80-CDD-Ant2-5290-PASS



11AX80-CDD-Ant3-5290-PASS



11AX80-CDD-Ant1-5530-PASS




11AX80-CDD-Ant2-5530-PASS



11AX80-CDD-Ant3-5530-PASS



11AX80-CDD-Ant1-5610-PASS

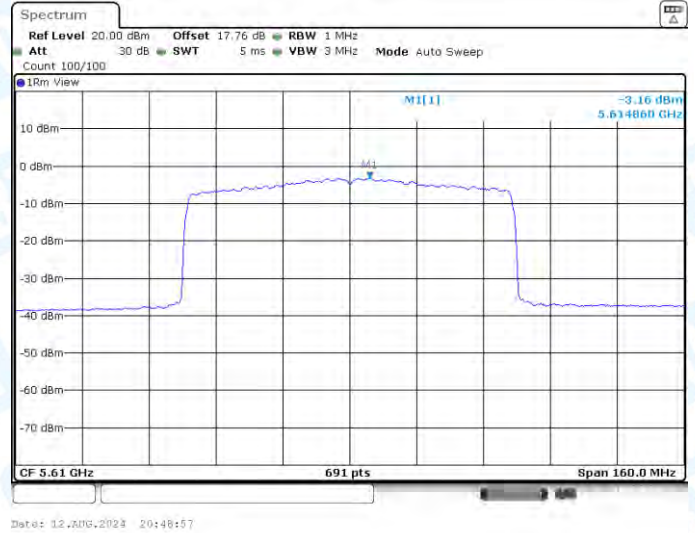


11AX80-CDD-Ant2-5610-PASS



11AX80-CDD-Ant3-5610-PASS




11AX80-CDD-Ant1-5690_UNII-2C-PASS

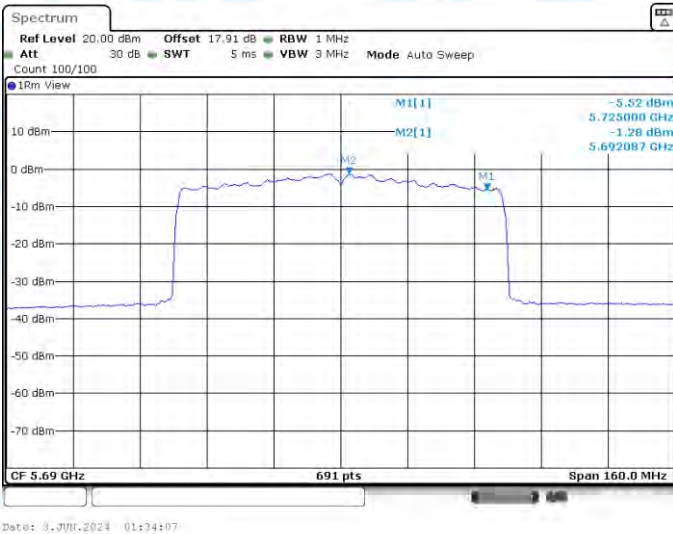


11AX80-CDD-Ant2-5690_UNII-2C-PASS



11AX80-CDD-Ant3-5690_UNII-2C-PASS

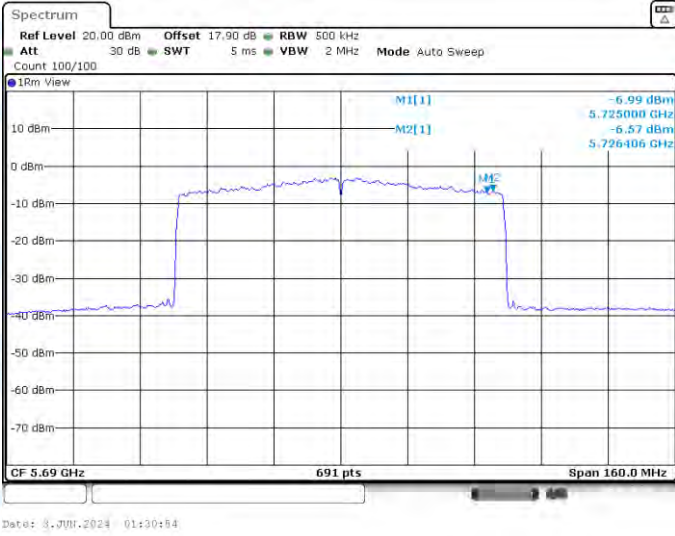

11AX80-CDD-Ant1-5690_UNII-3-PASS

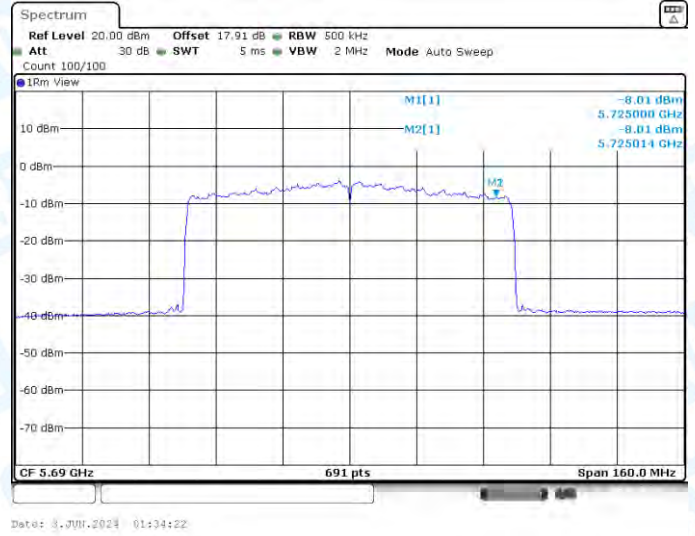


11AX80-CDD-Ant2-5690_UNII-3-PASS




11AX80-CDD-Ant3-5690_UNII-3-PASS




11AX80-CDD-Ant1-5775-PASS

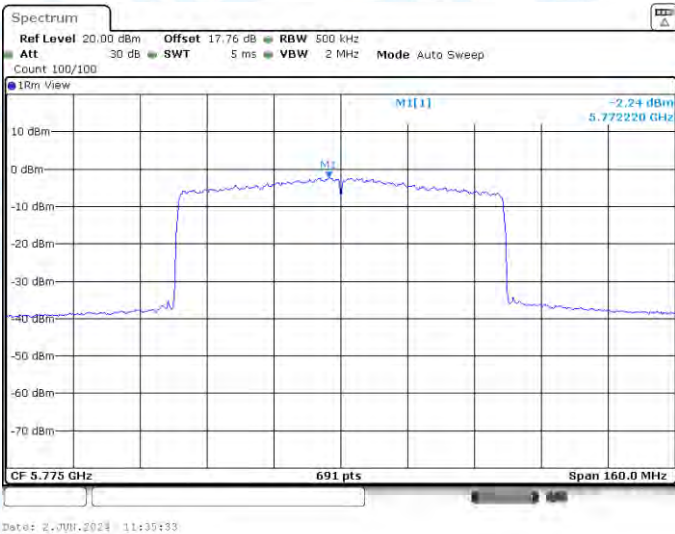


11AX80-CDD-Ant2-5775-PASS

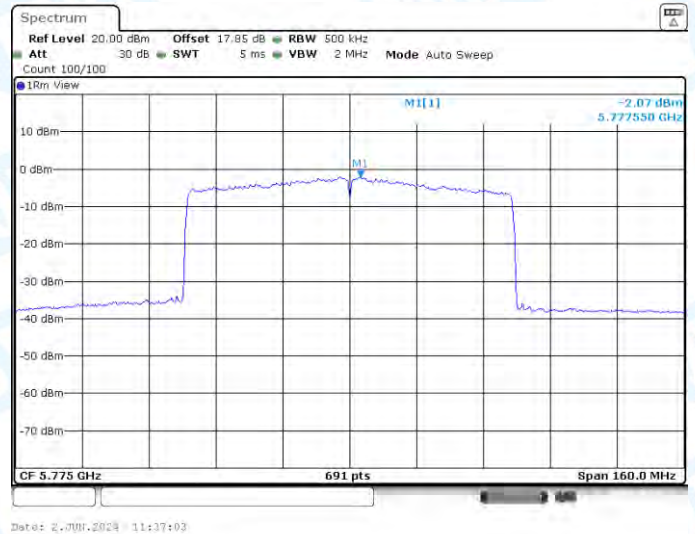

11AX80-CDD-Ant3-5775-PASS

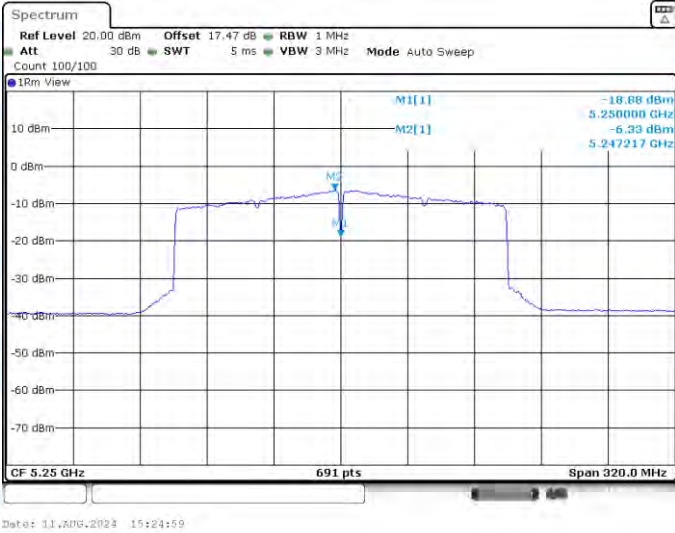


11AX160-CDD-Ant1-5250_UNII-1-PASS

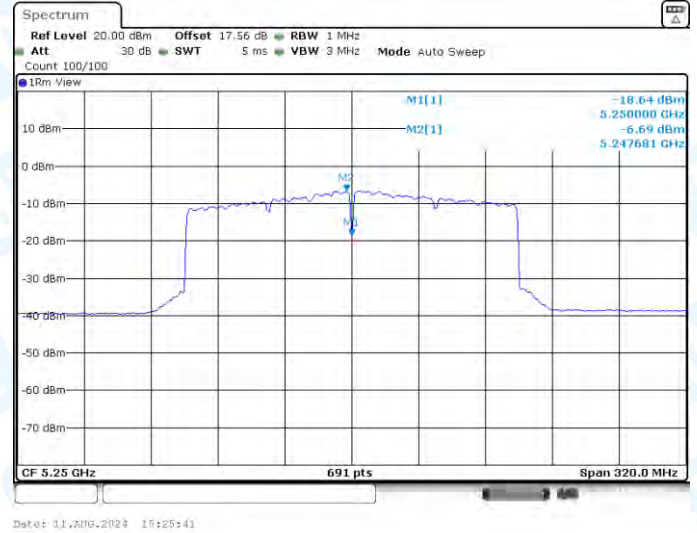


11AX160-CDD-Ant2-5250_UNII-1-PASS




11AX160-CDD-Ant3-5250_UNII-1-PASS

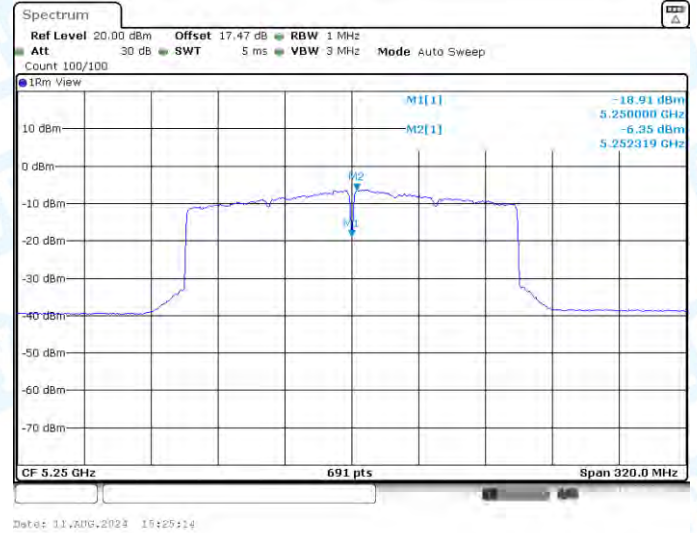

11AX160-CDD-Ant1-5250_UNII-2A-PASS

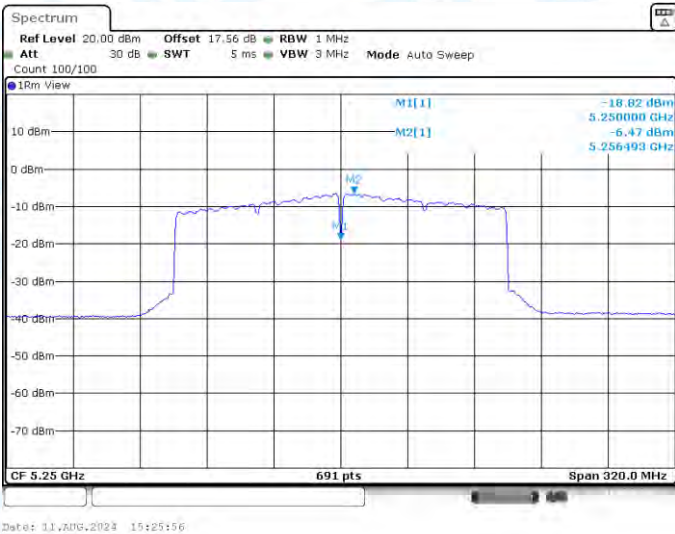


11AX160-CDD-Ant2-5250_UNII-2A-PASS

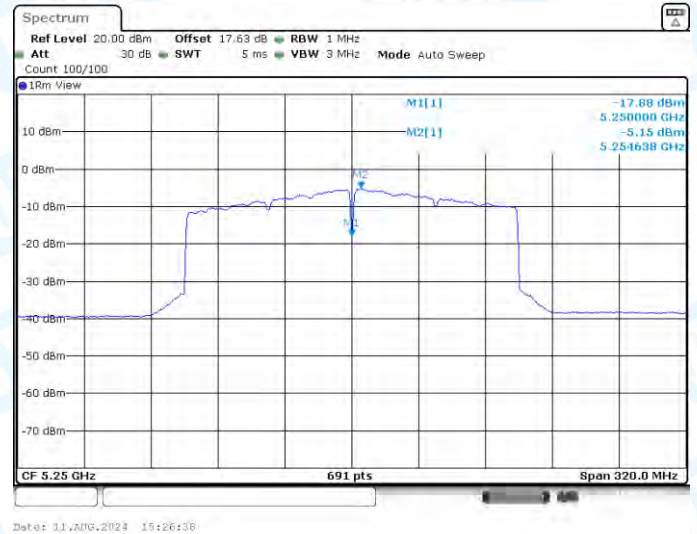

11AX160-CDD-Ant3-5250_UNII-2A-PASS



11AX160-CDD-Ant1-5570-PASS

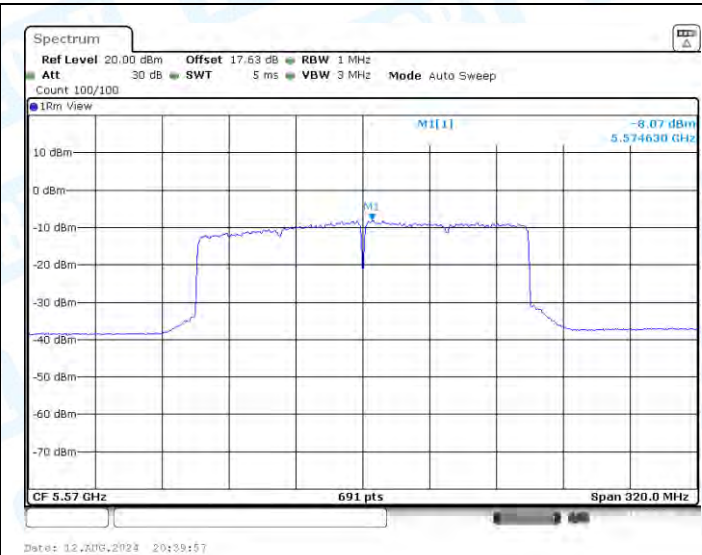

11AX160-CDD-Ant2-5570-PASS



11AX160-CDD-Ant3-5570-PASS

7: Conducted Spurious Emission

7.1 Test Result

TestMode	Antenna	Frequency [MHz]	FreqRange [MHz]	Max. Fre [MHz]	Max. Level [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	30~1000	892.45	-44.57	≤-27	PASS
11A	Ant1	5180	1000~40000	6935.8	-38.42	≤-27	PASS
11A	Ant2	5180	30~1000	859.89	-44.43	≤-27	PASS
11A	Ant2	5180	1000~40000	6935.8	-37.5	≤-27	PASS
11A	Ant3	5180	30~1000	860.5	-44.52	≤-27	PASS
11A	Ant3	5180	1000~40000	6980	-37.85	≤-27	PASS
11A	Ant1	5200	30~1000	890.28	-45.83	≤-27	PASS
11A	Ant1	5200	1000~40000	6982.6	-37.87	≤-27	PASS
11A	Ant2	5200	30~1000	707.41	-44.05	≤-27	PASS
11A	Ant2	5200	1000~40000	6996.9	-37.91	≤-27	PASS
11A	Ant3	5200	30~1000	508.73	-44.96	≤-27	PASS
11A	Ant3	5200	1000~40000	6999.5	-37.86	≤-27	PASS
11A	Ant1	5240	30~1000	891.41	-44.86	≤-27	PASS
11A	Ant1	5240	1000~40000	6864.3	-38.15	≤-27	PASS
11A	Ant2	5240	30~1000	889.28	-45.33	≤-27	PASS
11A	Ant2	5240	1000~40000	6917.6	-38.02	≤-27	PASS
11A	Ant3	5240	30~1000	965.26	-44.61	≤-27	PASS
11A	Ant3	5240	1000~40000	6778.5	-38.35	≤-27	PASS
11A	Ant1	5260	30~1000	891.25	-45.16	≤-27	PASS
11A	Ant1	5260	1000~40000	6891.6	-37.63	≤-27	PASS
11A	Ant2	5260	30~1000	897.43	-44.55	≤-27	PASS
11A	Ant2	5260	1000~40000	6926.7	-37.71	≤-27	PASS
11A	Ant3	5260	30~1000	866.71	-44.44	≤-27	PASS
11A	Ant3	5260	1000~40000	6757.7	-36.96	≤-27	PASS
11A	Ant1	5280	30~1000	890.8	-44.97	≤-27	PASS
11A	Ant1	5280	1000~40000	6918.9	-37.58	≤-27	PASS
11A	Ant2	5280	30~1000	860.86	-45.09	≤-27	PASS
11A	Ant2	5280	1000~40000	6922.8	-37.3	≤-27	PASS
11A	Ant3	5280	30~1000	120.35	-44.46	≤-27	PASS
11A	Ant3	5280	1000~40000	6739.5	-37.07	≤-27	PASS
11A	Ant1	5320	30~1000	860.31	-44.54	≤-27	PASS
11A	Ant1	5320	1000~40000	6993	-37.1	≤-27	PASS
11A	Ant2	5320	30~1000	862.54	-43.05	≤-27	PASS
11A	Ant2	5320	1000~40000	6891.6	-37.82	≤-27	PASS
11A	Ant3	5320	30~1000	958.34	-44.59	≤-27	PASS
11A	Ant3	5320	1000~40000	6891.6	-37.55	≤-27	PASS
11A	Ant1	5500	30~1000	860.44	-43.87	≤-27	PASS
11A	Ant1	5500	1000~40000	39422.8	-37.3	≤-27	PASS
11A	Ant2	5500	30~1000	888.7	-43.88	≤-27	PASS
11A	Ant2	5500	1000~40000	6838.3	-37.2	≤-27	PASS
11A	Ant3	5500	30~1000	706.02	-44.75	≤-27	PASS
11A	Ant3	5500	1000~40000	39322.7	-36.78	≤-27	PASS
11A	Ant1	5580	30~1000	116.25	-44.97	≤-27	PASS
11A	Ant1	5580	1000~40000	6951.4	-37.46	≤-27	PASS
11A	Ant2	5580	30~1000	958.76	-44.64	≤-27	PASS
11A	Ant2	5580	1000~40000	6943.6	-36.97	≤-27	PASS
11A	Ant3	5580	30~1000	869.59	-45.46	≤-27	PASS
11A	Ant3	5580	1000~40000	6866.9	-36.74	≤-27	PASS
11A	Ant1	5720	30~1000	861.7	-44.59	≤-27	PASS
11A	Ant1	5720	1000~40000	6967	-36.91	≤-27	PASS
11A	Ant2	5720	30~1000	708.35	-45.59	≤-27	PASS
11A	Ant2	5720	1000~40000	6950.1	-37.12	≤-27	PASS
11A	Ant3	5720	30~1000	865.39	-44.16	≤-27	PASS
11A	Ant3	5720	1000~40000	6934.5	-36.41	≤-27	PASS
11A	Ant1	5745	30~1000	861.83	-44.53	≤-27	PASS
11A	Ant1	5745	1000~40000	6950.1	-37.52	≤-27	PASS
11A	Ant2	5745	30~1000	863.83	-45.16	≤-27	PASS
11A	Ant2	5745	1000~40000	6965.7	-37.86	≤-27	PASS
11A	Ant3	5745	30~1000	889.08	-44.39	≤-27	PASS
11A	Ant3	5745	1000~40000	6939.7	-36.71	≤-27	PASS
11A	Ant1	5785	30~1000	595.02	-44.64	≤-27	PASS
11A	Ant1	5785	1000~40000	6866.9	-37.36	≤-27	PASS

11A	Ant2	5785	30~1000	959.63	-44.21	≤-27	PASS
11A	Ant2	5785	1000~40000	39439.7	-37.72	≤-27	PASS
11A	Ant3	5785	30~1000	860.63	-44.78	≤-27	PASS
11A	Ant3	5785	1000~40000	5865.9	-38.16	≤-27	PASS
11A	Ant1	5825	30~1000	863.41	-45.36	≤-27	PASS
11A	Ant1	5825	1000~40000	6972.2	-37.76	≤-27	PASS
11A	Ant2	5825	30~1000	862.35	-44.1	≤-27	PASS
11A	Ant2	5825	1000~40000	6983.9	-37.36	≤-27	PASS
11A	Ant3	5825	30~1000	860.05	-43.48	≤-27	PASS
11A	Ant3	5825	1000~40000	39308.4	-37.12	≤-27	PASS
11A-CDD	Ant1	5180	30~1000	862.35	-45.32	≤-27	PASS
11A-CDD	Ant1	5180	1000~40000	2446.9	-36.49	≤-27	PASS
11A-CDD	Ant2	5180	30~1000	711	-45.48	≤-27	PASS
11A-CDD	Ant2	5180	1000~40000	6786.3	-38.28	≤-27	PASS
11A-CDD	Ant3	5180	30~1000	869.07	-44.68	≤-27	PASS
11A-CDD	Ant3	5180	1000~40000	6902	-37.69	≤-27	PASS
11A-CDD	Ant1	5200	30~1000	888.47	-45.22	≤-27	PASS
11A-CDD	Ant1	5200	1000~40000	6956.6	-37.58	≤-27	PASS
11A-CDD	Ant2	5200	30~1000	960.73	-45.34	≤-27	PASS
11A-CDD	Ant2	5200	1000~40000	6980	-38.18	≤-27	PASS
11A-CDD	Ant3	5200	30~1000	860.99	-44.53	≤-27	PASS
11A-CDD	Ant3	5200	1000~40000	6995.6	-38.29	≤-27	PASS
11A-CDD	Ant1	5240	30~1000	966.04	-44.52	≤-27	PASS
11A-CDD	Ant1	5240	1000~40000	6929.3	-38.18	≤-27	PASS
11A-CDD	Ant2	5240	30~1000	888.15	-45.62	≤-27	PASS
11A-CDD	Ant2	5240	1000~40000	6921.5	-37.82	≤-27	PASS
11A-CDD	Ant3	5240	30~1000	892.16	-45.45	≤-27	PASS
11A-CDD	Ant3	5240	1000~40000	39350	-37.12	≤-27	PASS
11A-CDD	Ant1	5260	30~1000	892.29	-44.9	≤-27	PASS
11A-CDD	Ant1	5260	1000~40000	6812.3	-37.79	≤-27	PASS
11A-CDD	Ant2	5260	30~1000	860.79	-43.86	≤-27	PASS
11A-CDD	Ant2	5260	1000~40000	6989.1	-37.24	≤-27	PASS
11A-CDD	Ant3	5260	30~1000	890.44	-43.63	≤-27	PASS
11A-CDD	Ant3	5260	1000~40000	6964.4	-37.27	≤-27	PASS
11A-CDD	Ant1	5280	30~1000	508.66	-44.97	≤-27	PASS
11A-CDD	Ant1	5280	1000~40000	6985.2	-37.62	≤-27	PASS
11A-CDD	Ant2	5280	30~1000	889.02	-45.03	≤-27	PASS
11A-CDD	Ant2	5280	1000~40000	6956.6	-37.95	≤-27	PASS
11A-CDD	Ant3	5280	30~1000	860.57	-44.66	≤-27	PASS
11A-CDD	Ant3	5280	1000~40000	6991.7	-37.21	≤-27	PASS
11A-CDD	Ant1	5320	30~1000	961.9	-45.79	≤-27	PASS
11A-CDD	Ant1	5320	1000~40000	6974.8	-38.06	≤-27	PASS
11A-CDD	Ant2	5320	30~1000	711.58	-45.18	≤-27	PASS
11A-CDD	Ant2	5320	1000~40000	6859.1	-37.61	≤-27	PASS
11A-CDD	Ant3	5320	30~1000	963.13	-43.97	≤-27	PASS
11A-CDD	Ant3	5320	1000~40000	6946.2	-37.41	≤-27	PASS
11A-CDD	Ant1	5500	30~1000	958.76	-43.59	≤-27	PASS
11A-CDD	Ant1	5500	1000~40000	6959.2	-37.25	≤-27	PASS
11A-CDD	Ant2	5500	30~1000	890.28	-44.43	≤-27	PASS
11A-CDD	Ant2	5500	1000~40000	6947.5	-37.78	≤-27	PASS
11A-CDD	Ant3	5500	30~1000	890.51	-44.53	≤-27	PASS
11A-CDD	Ant3	5500	1000~40000	6976.1	-37.34	≤-27	PASS
11A-CDD	Ant1	5580	30~1000	888.5	-45.26	≤-27	PASS
11A-CDD	Ant1	5580	1000~40000	6994.3	-37.47	≤-27	PASS
11A-CDD	Ant2	5580	30~1000	717.27	-45.17	≤-27	PASS
11A-CDD	Ant2	5580	1000~40000	39977.9	-37.18	≤-27	PASS
11A-CDD	Ant3	5580	30~1000	892.74	-43.96	≤-27	PASS
11A-CDD	Ant3	5580	1000~40000	6742.1	-37.07	≤-27	PASS
11A-CDD	Ant1	5720	30~1000	509.31	-44.99	≤-27	PASS
11A-CDD	Ant1	5720	1000~40000	39344.8	-37.31	≤-27	PASS
11A-CDD	Ant2	5720	30~1000	860.92	-43.51	≤-27	PASS
11A-CDD	Ant2	5720	1000~40000	6818.8	-37.55	≤-27	PASS
11A-CDD	Ant3	5720	30~1000	892.93	-44.76	≤-27	PASS
11A-CDD	Ant3	5720	1000~40000	6935.8	-37.77	≤-27	PASS
11A-CDD	Ant1	5745	30~1000	889.99	-45.69	≤-27	PASS
11A-CDD	Ant1	5745	1000~40000	6993	-36.47	≤-27	PASS
11A-CDD	Ant2	5745	30~1000	893.61	-44.13	≤-27	PASS
11A-CDD	Ant2	5745	1000~40000	6908.5	-37.24	≤-27	PASS
11A-CDD	Ant3	5745	30~1000	889.7	-43.25	≤-27	PASS
11A-CDD	Ant3	5745	1000~40000	6977.4	-36.39	≤-27	PASS

11A-CDD	Ant1	5785	30~1000	959.21	-43	≤-27	PASS
11A-CDD	Ant1	5785	1000~40000	6956.6	-37.17	≤-27	PASS
11A-CDD	Ant2	5785	30~1000	890.54	-44.98	≤-27	PASS
11A-CDD	Ant2	5785	1000~40000	39305.8	-37.62	≤-27	PASS
11A-CDD	Ant3	5785	30~1000	888.11	-42.55	≤-27	PASS
11A-CDD	Ant3	5785	1000~40000	6976.1	-36.79	≤-27	PASS
11A-CDD	Ant1	5825	30~1000	958.83	-43.71	≤-27	PASS
11A-CDD	Ant1	5825	1000~40000	6859.1	-37.02	≤-27	PASS
11A-CDD	Ant2	5825	30~1000	861.18	-43.39	≤-27	PASS
11A-CDD	Ant2	5825	1000~40000	6981.3	-37.44	≤-27	PASS
11A-CDD	Ant3	5825	30~1000	764.19	-44.47	≤-27	PASS
11A-CDD	Ant3	5825	1000~40000	6991.7	-36.88	≤-27	PASS
11N20-CDD	Ant1	5180	30~1000	508.7	-45.99	≤-27	PASS
11N20-CDD	Ant1	5180	1000~40000	6912.4	-38.73	≤-27	PASS
11N20-CDD	Ant2	5180	30~1000	964.26	-44.82	≤-27	PASS
11N20-CDD	Ant2	5180	1000~40000	6957.9	-37.65	≤-27	PASS
11N20-CDD	Ant3	5180	30~1000	511.22	-45.46	≤-27	PASS
11N20-CDD	Ant3	5180	1000~40000	6902	-38.29	≤-27	PASS
11N20-CDD	Ant1	5200	30~1000	860.21	-46.05	≤-27	PASS
11N20-CDD	Ant1	5200	1000~40000	6977.4	-36.9	≤-27	PASS
11N20-CDD	Ant2	5200	30~1000	961.35	-45.74	≤-27	PASS
11N20-CDD	Ant2	5200	1000~40000	6916.3	-38.37	≤-27	PASS
11N20-CDD	Ant3	5200	30~1000	866.81	-44.96	≤-27	PASS
11N20-CDD	Ant3	5200	1000~40000	6704.4	-38.01	≤-27	PASS
11N20-CDD	Ant1	5240	30~1000	890.28	-44.21	≤-27	PASS
11N20-CDD	Ant1	5240	1000~40000	6960.5	-38.4	≤-27	PASS
11N20-CDD	Ant2	5240	30~1000	888.63	-46	≤-27	PASS
11N20-CDD	Ant2	5240	1000~40000	6950.1	-37.91	≤-27	PASS
11N20-CDD	Ant3	5240	30~1000	512.06	-44.73	≤-27	PASS
11N20-CDD	Ant3	5240	1000~40000	6995.6	-36.74	≤-27	PASS
11N20-CDD	Ant1	5260	30~1000	861.93	-43	≤-27	PASS
11N20-CDD	Ant1	5260	1000~40000	6911.1	-37.93	≤-27	PASS
11N20-CDD	Ant2	5260	30~1000	706.02	-43.94	≤-27	PASS
11N20-CDD	Ant2	5260	1000~40000	6973.5	-37.57	≤-27	PASS
11N20-CDD	Ant3	5260	30~1000	705.53	-44.55	≤-27	PASS
11N20-CDD	Ant3	5260	1000~40000	6898.1	-37.63	≤-27	PASS
11N20-CDD	Ant1	5280	30~1000	706.31	-43.54	≤-27	PASS
11N20-CDD	Ant1	5280	1000~40000	6808.4	-37.51	≤-27	PASS
11N20-CDD	Ant2	5280	30~1000	874.08	-44.68	≤-27	PASS
11N20-CDD	Ant2	5280	1000~40000	6779.8	-37.54	≤-27	PASS
11N20-CDD	Ant3	5280	30~1000	892.29	-44.76	≤-27	PASS
11N20-CDD	Ant3	5280	1000~40000	6995.6	-37.59	≤-27	PASS
11N20-CDD	Ant1	5320	30~1000	509.08	-45.08	≤-27	PASS
11N20-CDD	Ant1	5320	1000~40000	6960.5	-37.86	≤-27	PASS
11N20-CDD	Ant2	5320	30~1000	708.74	-43.64	≤-27	PASS
11N20-CDD	Ant2	5320	1000~40000	6948.8	-37.73	≤-27	PASS
11N20-CDD	Ant3	5320	30~1000	890.18	-45.17	≤-27	PASS
11N20-CDD	Ant3	5320	1000~40000	6948.8	-37.56	≤-27	PASS
11N20-CDD	Ant1	5500	30~1000	889.21	-43.81	≤-27	PASS
11N20-CDD	Ant1	5500	1000~40000	6833.1	-37.97	≤-27	PASS
11N20-CDD	Ant2	5500	30~1000	964.1	-44.45	≤-27	PASS
11N20-CDD	Ant2	5500	1000~40000	6954	-36.8	≤-27	PASS
11N20-CDD	Ant3	5500	30~1000	891.41	-44.47	≤-27	PASS
11N20-CDD	Ant3	5500	1000~40000	6713.5	-37.61	≤-27	PASS
11N20-CDD	Ant1	5580	30~1000	958.44	-42.85	≤-27	PASS
11N20-CDD	Ant1	5580	1000~40000	6968.3	-37.29	≤-27	PASS
11N20-CDD	Ant2	5580	30~1000	706.57	-44.87	≤-27	PASS
11N20-CDD	Ant2	5580	1000~40000	6956.6	-36.85	≤-27	PASS
11N20-CDD	Ant3	5580	30~1000	861.54	-45.22	≤-27	PASS
11N20-CDD	Ant3	5580	1000~40000	39727	-37.15	≤-27	PASS
11N20-CDD	Ant1	5720	30~1000	889.25	-44.08	≤-27	PASS
11N20-CDD	Ant1	5720	1000~40000	6842.2	-37.21	≤-27	PASS
11N20-CDD	Ant2	5720	30~1000	958.53	-43.95	≤-27	PASS
11N20-CDD	Ant2	5720	1000~40000	6980	-37.55	≤-27	PASS
11N20-CDD	Ant3	5720	30~1000	888.66	-42.89	≤-27	PASS
11N20-CDD	Ant3	5720	1000~40000	6963.1	-36.96	≤-27	PASS
11N20-CDD	Ant1	5745	30~1000	865.61	-42.94	≤-27	PASS
11N20-CDD	Ant1	5745	1000~40000	39929.8	-37.25	≤-27	PASS
11N20-CDD	Ant2	5745	30~1000	861.05	-43.81	≤-27	PASS
11N20-CDD	Ant2	5745	1000~40000	6935.8	-38.09	≤-27	PASS

11N20-CDD	Ant3	5745	30~1000	865.45	-43.67	≤-27	PASS
11N20-CDD	Ant3	5745	1000~40000	39975.3	-37.62	≤-27	PASS
11N20-CDD	Ant1	5785	30~1000	862.67	-43.2	≤-27	PASS
11N20-CDD	Ant1	5785	1000~40000	6916.3	-37.31	≤-27	PASS
11N20-CDD	Ant2	5785	30~1000	865.19	-44.66	≤-27	PASS
11N20-CDD	Ant2	5785	1000~40000	6996.9	-37.54	≤-27	PASS
11N20-CDD	Ant3	5785	30~1000	860.66	-43.46	≤-27	PASS
11N20-CDD	Ant3	5785	1000~40000	6982.6	-37.15	≤-27	PASS
11N20-CDD	Ant1	5825	30~1000	960.38	-44.2	≤-27	PASS
11N20-CDD	Ant1	5825	1000~40000	39976.6	-37.72	≤-27	PASS
11N20-CDD	Ant2	5825	30~1000	891.83	-44.58	≤-27	PASS
11N20-CDD	Ant2	5825	1000~40000	6939.7	-36.84	≤-27	PASS
11N20-CDD	Ant3	5825	30~1000	889.28	-44.17	≤-27	PASS
11N20-CDD	Ant3	5825	1000~40000	6896.8	-37.83	≤-27	PASS
11N40-CDD	Ant1	5190	30~1000	960.18	-46	≤-27	PASS
11N40-CDD	Ant1	5190	1000~40000	6954	-36.95	≤-27	PASS
11N40-CDD	Ant2	5190	30~1000	968.43	-45.69	≤-27	PASS
11N40-CDD	Ant2	5190	1000~40000	6970.9	-38.6	≤-27	PASS
11N40-CDD	Ant3	5190	30~1000	863.15	-44.72	≤-27	PASS
11N40-CDD	Ant3	5190	1000~40000	6868.2	-38.36	≤-27	PASS
11N40-CDD	Ant1	5230	30~1000	888.63	-44.98	≤-27	PASS
11N40-CDD	Ant1	5230	1000~40000	6874.7	-38.21	≤-27	PASS
11N40-CDD	Ant2	5230	30~1000	865.19	-44.05	≤-27	PASS
11N40-CDD	Ant2	5230	1000~40000	6994.3	-38.39	≤-27	PASS
11N40-CDD	Ant3	5230	30~1000	861.15	-45.92	≤-27	PASS
11N40-CDD	Ant3	5230	1000~40000	6892.9	-37.37	≤-27	PASS
11N40-CDD	Ant1	5270	30~1000	975.02	-45.17	≤-27	PASS
11N40-CDD	Ant1	5270	1000~40000	6941	-37.08	≤-27	PASS
11N40-CDD	Ant2	5270	30~1000	861.73	-45.48	≤-27	PASS
11N40-CDD	Ant2	5270	1000~40000	6994.3	-37.82	≤-27	PASS
11N40-CDD	Ant3	5270	30~1000	893.29	-43.35	≤-27	PASS
11N40-CDD	Ant3	5270	1000~40000	6993	-37.76	≤-27	PASS
11N40-CDD	Ant1	5310	30~1000	891.93	-44.23	≤-27	PASS
11N40-CDD	Ant1	5310	1000~40000	6981.3	-37.76	≤-27	PASS
11N40-CDD	Ant2	5310	30~1000	958.99	-42.47	≤-27	PASS
11N40-CDD	Ant2	5310	1000~40000	6951.4	-37.84	≤-27	PASS
11N40-CDD	Ant3	5310	30~1000	861.7	-44.06	≤-27	PASS
11N40-CDD	Ant3	5310	1000~40000	6986.5	-36.74	≤-27	PASS
11N40-CDD	Ant1	5510	30~1000	888.15	-44.91	≤-27	PASS
11N40-CDD	Ant1	5510	1000~40000	6978.7	-38.12	≤-27	PASS
11N40-CDD	Ant2	5510	30~1000	709.32	-45.03	≤-27	PASS
11N40-CDD	Ant2	5510	1000~40000	6955.3	-37.66	≤-27	PASS
11N40-CDD	Ant3	5510	30~1000	894.42	-45.5	≤-27	PASS
11N40-CDD	Ant3	5510	1000~40000	6878.6	-37.05	≤-27	PASS
11N40-CDD	Ant1	5550	30~1000	895.16	-44.04	≤-27	PASS
11N40-CDD	Ant1	5550	1000~40000	6987.8	-37.75	≤-27	PASS
11N40-CDD	Ant2	5550	30~1000	888.83	-45.71	≤-27	PASS
11N40-CDD	Ant2	5550	1000~40000	6831.8	-36.95	≤-27	PASS
11N40-CDD	Ant3	5550	30~1000	889.86	-44.53	≤-27	PASS
11N40-CDD	Ant3	5550	1000~40000	6820.1	-37.26	≤-27	PASS
11N40-CDD	Ant1	5710	30~1000	705.6	-44.35	≤-27	PASS
11N40-CDD	Ant1	5710	1000~40000	6999.5	-36.64	≤-27	PASS
11N40-CDD	Ant2	5710	30~1000	860.96	-43.42	≤-27	PASS
11N40-CDD	Ant2	5710	1000~40000	39385.1	-36.93	≤-27	PASS
11N40-CDD	Ant3	5710	30~1000	958.92	-44.72	≤-27	PASS
11N40-CDD	Ant3	5710	1000~40000	6985.2	-35.91	≤-27	PASS
11N40-CDD	Ant1	5755	30~1000	860.79	-43.08	≤-27	PASS
11N40-CDD	Ant1	5755	1000~40000	6957.9	-37.87	≤-27	PASS
11N40-CDD	Ant2	5755	30~1000	712.55	-44.88	≤-27	PASS
11N40-CDD	Ant2	5755	1000~40000	6878.6	-37.81	≤-27	PASS
11N40-CDD	Ant3	5755	30~1000	705.21	-44.89	≤-27	PASS
11N40-CDD	Ant3	5755	1000~40000	6868.2	-36.7	≤-27	PASS
11N40-CDD	Ant1	5795	30~1000	891.28	-44.61	≤-27	PASS
11N40-CDD	Ant1	5795	1000~40000	6937.1	-37.95	≤-27	PASS
11N40-CDD	Ant2	5795	30~1000	860.08	-44.36	≤-27	PASS
11N40-CDD	Ant2	5795	1000~40000	6913.7	-37.96	≤-27	PASS
11N40-CDD	Ant3	5795	30~1000	870.36	-44.7	≤-27	PASS
11N40-CDD	Ant3	5795	1000~40000	39989.6	-37.44	≤-27	PASS
11AC20-CDD	Ant1	5180	30~1000	508.95	-45.09	≤-27	PASS
11AC20-CDD	Ant1	5180	1000~40000	39515.1	-38.62	≤-27	PASS

11AC20-CDD	Ant2	5180	30~1000	888.11	-44.21	≤-27	PASS
11AC20-CDD	Ant2	5180	1000~40000	6980	-37.95	≤-27	PASS
11AC20-CDD	Ant3	5180	30~1000	888.11	-45.71	≤-27	PASS
11AC20-CDD	Ant3	5180	1000~40000	6980	-37.61	≤-27	PASS
11AC20-CDD	Ant1	5200	30~1000	707.35	-45.44	≤-27	PASS
11AC20-CDD	Ant1	5200	1000~40000	39951.9	-38.01	≤-27	PASS
11AC20-CDD	Ant2	5200	30~1000	863.38	-44	≤-27	PASS
11AC20-CDD	Ant2	5200	1000~40000	6987.8	-38.26	≤-27	PASS
11AC20-CDD	Ant3	5200	30~1000	888.89	-45.33	≤-27	PASS
11AC20-CDD	Ant3	5200	1000~40000	39299.3	-38.32	≤-27	PASS
11AC20-CDD	Ant1	5240	30~1000	115.21	-46.16	≤-27	PASS
11AC20-CDD	Ant1	5240	1000~40000	6870.8	-38.26	≤-27	PASS
11AC20-CDD	Ant2	5240	30~1000	860.63	-44.45	≤-27	PASS
11AC20-CDD	Ant2	5240	1000~40000	6993	-38.25	≤-27	PASS
11AC20-CDD	Ant3	5240	30~1000	896.46	-45.1	≤-27	PASS
11AC20-CDD	Ant3	5240	1000~40000	6976.1	-37.26	≤-27	PASS
11AC20-CDD	Ant1	5260	30~1000	705.6	-43.58	≤-27	PASS
11AC20-CDD	Ant1	5260	1000~40000	39340.9	-37.91	≤-27	PASS
11AC20-CDD	Ant2	5260	30~1000	861.76	-44.13	≤-27	PASS
11AC20-CDD	Ant2	5260	1000~40000	6847.4	-37.32	≤-27	PASS
11AC20-CDD	Ant3	5260	30~1000	938.17	-44.9	≤-27	PASS
11AC20-CDD	Ant3	5260	1000~40000	39994.8	-37.21	≤-27	PASS
11AC20-CDD	Ant1	5280	30~1000	965.94	-44.9	≤-27	PASS
11AC20-CDD	Ant1	5280	1000~40000	6965.7	-37.52	≤-27	PASS
11AC20-CDD	Ant2	5280	30~1000	716.59	-45.21	≤-27	PASS
11AC20-CDD	Ant2	5280	1000~40000	6924.1	-37.67	≤-27	PASS
11AC20-CDD	Ant3	5280	30~1000	890.67	-44.05	≤-27	PASS
11AC20-CDD	Ant3	5280	1000~40000	39426.7	-37.12	≤-27	PASS
11AC20-CDD	Ant1	5320	30~1000	890.83	-44.06	≤-27	PASS
11AC20-CDD	Ant1	5320	1000~40000	6978.7	-36.88	≤-27	PASS
11AC20-CDD	Ant2	5320	30~1000	889.31	-44.49	≤-27	PASS
11AC20-CDD	Ant2	5320	1000~40000	6859.1	-37.64	≤-27	PASS
11AC20-CDD	Ant3	5320	30~1000	961.09	-43.25	≤-27	PASS
11AC20-CDD	Ant3	5320	1000~40000	39329.2	-37.5	≤-27	PASS
11AC20-CDD	Ant1	5500	30~1000	958.83	-43.57	≤-27	PASS
11AC20-CDD	Ant1	5500	1000~40000	6905.9	-37.98	≤-27	PASS
11AC20-CDD	Ant2	5500	30~1000	863.12	-42.93	≤-27	PASS
11AC20-CDD	Ant2	5500	1000~40000	6944.9	-37.64	≤-27	PASS
11AC20-CDD	Ant3	5500	30~1000	709.41	-44.46	≤-27	PASS
11AC20-CDD	Ant3	5500	1000~40000	6905.9	-37.26	≤-27	PASS
11AC20-CDD	Ant1	5580	30~1000	511.35	-43.91	≤-27	PASS
11AC20-CDD	Ant1	5580	1000~40000	6848.7	-37.41	≤-27	PASS
11AC20-CDD	Ant2	5580	30~1000	958.44	-44.97	≤-27	PASS
11AC20-CDD	Ant2	5580	1000~40000	39983.1	-37.67	≤-27	PASS
11AC20-CDD	Ant3	5580	30~1000	860.76	-43.24	≤-27	PASS
11AC20-CDD	Ant3	5580	1000~40000	6961.8	-37.16	≤-27	PASS
11AC20-CDD	Ant1	5720	30~1000	861.51	-44.61	≤-27	PASS
11AC20-CDD	Ant1	5720	1000~40000	6504.2	-37.67	≤-27	PASS
11AC20-CDD	Ant2	5720	30~1000	862.57	-42.91	≤-27	PASS
11AC20-CDD	Ant2	5720	1000~40000	6972.2	-37.17	≤-27	PASS
11AC20-CDD	Ant3	5720	30~1000	862.73	-43.5	≤-27	PASS
11AC20-CDD	Ant3	5720	1000~40000	6970.9	-36.78	≤-27	PASS
11AC20-CDD	Ant1	5745	30~1000	960.99	-44.3	≤-27	PASS
11AC20-CDD	Ant1	5745	1000~40000	6991.7	-37.19	≤-27	PASS
11AC20-CDD	Ant2	5745	30~1000	889.25	-43.14	≤-27	PASS
11AC20-CDD	Ant2	5745	1000~40000	6989.1	-37.44	≤-27	PASS
11AC20-CDD	Ant3	5745	30~1000	707.02	-43.74	≤-27	PASS
11AC20-CDD	Ant3	5745	1000~40000	6970.9	-37.52	≤-27	PASS
11AC20-CDD	Ant1	5785	30~1000	862.18	-44.57	≤-27	PASS
11AC20-CDD	Ant1	5785	1000~40000	6995.6	-38.14	≤-27	PASS
11AC20-CDD	Ant2	5785	30~1000	861.57	-43.61	≤-27	PASS
11AC20-CDD	Ant2	5785	1000~40000	6970.9	-37.81	≤-27	PASS
11AC20-CDD	Ant3	5785	30~1000	707.18	-44.3	≤-27	PASS
11AC20-CDD	Ant3	5785	1000~40000	5917.9	-37.99	≤-27	PASS
11AC20-CDD	Ant1	5825	30~1000	893.16	-45.02	≤-27	PASS
11AC20-CDD	Ant1	5825	1000~40000	6843.5	-37.68	≤-27	PASS
11AC20-CDD	Ant2	5825	30~1000	508.6	-43.48	≤-27	PASS
11AC20-CDD	Ant2	5825	1000~40000	6956.6	-37.17	≤-27	PASS
11AC20-CDD	Ant3	5825	30~1000	861.05	-42.93	≤-27	PASS
11AC20-CDD	Ant3	5825	1000~40000	6970.9	-37.25	≤-27	PASS


11AC40-CDD	Ant1	5190	30~1000	862.96	-43.91	≤-27	PASS
11AC40-CDD	Ant1	5190	1000~40000	6982.6	-38.38	≤-27	PASS
11AC40-CDD	Ant2	5190	30~1000	889.05	-45.61	≤-27	PASS
11AC40-CDD	Ant2	5190	1000~40000	6995.6	-38.06	≤-27	PASS
11AC40-CDD	Ant3	5190	30~1000	888.21	-44.23	≤-27	PASS
11AC40-CDD	Ant3	5190	1000~40000	6697.9	-38.17	≤-27	PASS
11AC40-CDD	Ant1	5230	30~1000	862.6	-45.89	≤-27	PASS
11AC40-CDD	Ant1	5230	1000~40000	6778.5	-37.35	≤-27	PASS
11AC40-CDD	Ant2	5230	30~1000	861.7	-44.74	≤-27	PASS
11AC40-CDD	Ant2	5230	1000~40000	6913.7	-37.96	≤-27	PASS
11AC40-CDD	Ant3	5230	30~1000	763.54	-45.21	≤-27	PASS
11AC40-CDD	Ant3	5230	1000~40000	6981.3	-37.32	≤-27	PASS
11AC40-CDD	Ant1	5270	30~1000	866.84	-45.09	≤-27	PASS
11AC40-CDD	Ant1	5270	1000~40000	6835.7	-37.85	≤-27	PASS
11AC40-CDD	Ant2	5270	30~1000	862.7	-44.25	≤-27	PASS
11AC40-CDD	Ant2	5270	1000~40000	6943.6	-37.33	≤-27	PASS
11AC40-CDD	Ant3	5270	30~1000	866.45	-44.48	≤-27	PASS
11AC40-CDD	Ant3	5270	1000~40000	6955.3	-37.69	≤-27	PASS
11AC40-CDD	Ant1	5310	30~1000	958.47	-45.32	≤-27	PASS
11AC40-CDD	Ant1	5310	1000~40000	6855.2	-37.89	≤-27	PASS
11AC40-CDD	Ant2	5310	30~1000	861.28	-42.97	≤-27	PASS
11AC40-CDD	Ant2	5310	1000~40000	6864.3	-37.71	≤-27	PASS
11AC40-CDD	Ant3	5310	30~1000	866.13	-44.49	≤-27	PASS
11AC40-CDD	Ant3	5310	1000~40000	6967	-37.61	≤-27	PASS
11AC40-CDD	Ant1	5510	30~1000	890.12	-44.35	≤-27	PASS
11AC40-CDD	Ant1	5510	1000~40000	6980	-36.73	≤-27	PASS
11AC40-CDD	Ant2	5510	30~1000	863.93	-45.05	≤-27	PASS
11AC40-CDD	Ant2	5510	1000~40000	6749.9	-37.92	≤-27	PASS
11AC40-CDD	Ant3	5510	30~1000	862.93	-42.41	≤-27	PASS
11AC40-CDD	Ant3	5510	1000~40000	6995.6	-37.39	≤-27	PASS
11AC40-CDD	Ant1	5550	30~1000	389.84	-45.52	≤-27	PASS
11AC40-CDD	Ant1	5550	1000~40000	6896.8	-37.63	≤-27	PASS
11AC40-CDD	Ant2	5550	30~1000	861.08	-42.38	≤-27	PASS
11AC40-CDD	Ant2	5550	1000~40000	6983.9	-37.81	≤-27	PASS
11AC40-CDD	Ant3	5550	30~1000	894.06	-44.93	≤-27	PASS
11AC40-CDD	Ant3	5550	1000~40000	6882.5	-37.03	≤-27	PASS
11AC40-CDD	Ant1	5710	30~1000	869.14	-44.29	≤-27	PASS
11AC40-CDD	Ant1	5710	1000~40000	6857.8	-36.96	≤-27	PASS
11AC40-CDD	Ant2	5710	30~1000	892.71	-43.52	≤-27	PASS
11AC40-CDD	Ant2	5710	1000~40000	39422.8	-37.74	≤-27	PASS
11AC40-CDD	Ant3	5710	30~1000	944.53	-44.52	≤-27	PASS
11AC40-CDD	Ant3	5710	1000~40000	6955.3	-36.83	≤-27	PASS
11AC40-CDD	Ant1	5755	30~1000	888.37	-42.83	≤-27	PASS
11AC40-CDD	Ant1	5755	1000~40000	6924.1	-37.79	≤-27	PASS
11AC40-CDD	Ant2	5755	30~1000	960.6	-44.22	≤-27	PASS
11AC40-CDD	Ant2	5755	1000~40000	6918.9	-37.25	≤-27	PASS
11AC40-CDD	Ant3	5755	30~1000	888.28	-43.8	≤-27	PASS
11AC40-CDD	Ant3	5755	1000~40000	6925.4	-38.14	≤-27	PASS
11AC40-CDD	Ant1	5795	30~1000	890.47	-43.25	≤-27	PASS
11AC40-CDD	Ant1	5795	1000~40000	6942.3	-38.1	≤-27	PASS
11AC40-CDD	Ant2	5795	30~1000	889.02	-44.62	≤-27	PASS
11AC40-CDD	Ant2	5795	1000~40000	6950.1	-37.55	≤-27	PASS
11AC40-CDD	Ant3	5795	30~1000	864.58	-42.93	≤-27	PASS
11AC40-CDD	Ant3	5795	1000~40000	6964.4	-37.52	≤-27	PASS
11AC80-CDD	Ant1	5210	30~1000	897.33	-45.62	≤-27	PASS
11AC80-CDD	Ant1	5210	1000~40000	6947.5	-38.33	≤-27	PASS
11AC80-CDD	Ant2	5210	30~1000	869.75	-45.23	≤-27	PASS
11AC80-CDD	Ant2	5210	1000~40000	6879.9	-37.75	≤-27	PASS
11AC80-CDD	Ant3	5210	30~1000	859.95	-45.04	≤-27	PASS
11AC80-CDD	Ant3	5210	1000~40000	6986.5	-38.37	≤-27	PASS
11AC80-CDD	Ant1	5290	30~1000	514.58	-45.63	≤-27	PASS
11AC80-CDD	Ant1	5290	1000~40000	6955.3	-37.59	≤-27	PASS
11AC80-CDD	Ant2	5290	30~1000	705.41	-44.67	≤-27	PASS
11AC80-CDD	Ant2	5290	1000~40000	6991.7	-37.49	≤-27	PASS
11AC80-CDD	Ant3	5290	30~1000	965.78	-44.7	≤-27	PASS
11AC80-CDD	Ant3	5290	1000~40000	6883.8	-37.34	≤-27	PASS
11AC80-CDD	Ant1	5530	30~1000	872.79	-44.66	≤-27	PASS
11AC80-CDD	Ant1	5530	1000~40000	6995.6	-36.75	≤-27	PASS
11AC80-CDD	Ant2	5530	30~1000	860.28	-45.23	≤-27	PASS
11AC80-CDD	Ant2	5530	1000~40000	6895.5	-37.41	≤-27	PASS

11AC80-CDD	Ant3	5530	30~1000	888.24	-44.61	≤-27	PASS
11AC80-CDD	Ant3	5530	1000~40000	6972.2	-37.68	≤-27	PASS
11AC80-CDD	Ant1	5610	30~1000	862.64	-43.12	≤-27	PASS
11AC80-CDD	Ant1	5610	1000~40000	6991.7	-37.73	≤-27	PASS
11AC80-CDD	Ant2	5610	30~1000	958.86	-45.15	≤-27	PASS
11AC80-CDD	Ant2	5610	1000~40000	6911.1	-37.57	≤-27	PASS
11AC80-CDD	Ant3	5610	30~1000	888.99	-43.47	≤-27	PASS
11AC80-CDD	Ant3	5610	1000~40000	6753.8	-37.39	≤-27	PASS
11AC80-CDD	Ant1	5690	30~1000	944.79	-44.83	≤-27	PASS
11AC80-CDD	Ant1	5690	1000~40000	6948.8	-36.52	≤-27	PASS
11AC80-CDD	Ant2	5690	30~1000	889.63	-43.72	≤-27	PASS
11AC80-CDD	Ant2	5690	1000~40000	6886.4	-37.58	≤-27	PASS
11AC80-CDD	Ant3	5690	30~1000	961.19	-44.27	≤-27	PASS
11AC80-CDD	Ant3	5690	1000~40000	6804.5	-37.27	≤-27	PASS
11AC80-CDD	Ant1	5775	30~1000	708.12	-44.98	≤-27	PASS
11AC80-CDD	Ant1	5775	1000~40000	6899.4	-36.44	≤-27	PASS
11AC80-CDD	Ant2	5775	30~1000	893.87	-44.37	≤-27	PASS
11AC80-CDD	Ant2	5775	1000~40000	6965.7	-37.5	≤-27	PASS
11AC80-CDD	Ant3	5775	30~1000	964.45	-44.11	≤-27	PASS
11AC80-CDD	Ant3	5775	1000~40000	6829.2	-37.63	≤-27	PASS
11AC160-CDD	Ant1	5250	30~1000	892.64	-44.77	≤-27	PASS
11AC160-CDD	Ant1	5250	1000~40000	6742.1	-37.52	≤-27	PASS
11AC160-CDD	Ant2	5250	30~1000	889.47	-44.96	≤-27	PASS
11AC160-CDD	Ant2	5250	1000~40000	6929.3	-37.14	≤-27	PASS
11AC160-CDD	Ant3	5250	30~1000	890.83	-43.33	≤-27	PASS
11AC160-CDD	Ant3	5250	1000~40000	6899.4	-38.06	≤-27	PASS
11AC160-CDD	Ant1	5570	30~1000	861.02	-43.54	≤-27	PASS
11AC160-CDD	Ant1	5570	1000~40000	6980	-36.88	≤-27	PASS
11AC160-CDD	Ant2	5570	30~1000	888.21	-44.62	≤-27	PASS
11AC160-CDD	Ant2	5570	1000~40000	6999.5	-37.18	≤-27	PASS
11AC160-CDD	Ant3	5570	30~1000	863.09	-43.45	≤-27	PASS
11AC160-CDD	Ant3	5570	1000~40000	6980	-36.79	≤-27	PASS
11AX20-CDD	Ant1	5180	30~1000	762.5	-46.4	≤-27	PASS
11AX20-CDD	Ant1	5180	1000~40000	6982.6	-38.15	≤-27	PASS
11AX20-CDD	Ant2	5180	30~1000	860.34	-45.19	≤-27	PASS
11AX20-CDD	Ant2	5180	1000~40000	39496.9	-38.52	≤-27	PASS
11AX20-CDD	Ant3	5180	30~1000	861.12	-44.74	≤-27	PASS
11AX20-CDD	Ant3	5180	1000~40000	6993	-38.16	≤-27	PASS
11AX20-CDD	Ant1	5200	30~1000	512.58	-45.26	≤-27	PASS
11AX20-CDD	Ant1	5200	1000~40000	6957.9	-38.41	≤-27	PASS
11AX20-CDD	Ant2	5200	30~1000	892.35	-45.98	≤-27	PASS
11AX20-CDD	Ant2	5200	1000~40000	6969.6	-38.04	≤-27	PASS
11AX20-CDD	Ant3	5200	30~1000	862.51	-44.17	≤-27	PASS
11AX20-CDD	Ant3	5200	1000~40000	39987	-38.05	≤-27	PASS
11AX20-CDD	Ant1	5240	30~1000	861.6	-45.49	≤-27	PASS
11AX20-CDD	Ant1	5240	1000~40000	39226.5	-38.01	≤-27	PASS
11AX20-CDD	Ant2	5240	30~1000	888.02	-44.31	≤-27	PASS
11AX20-CDD	Ant2	5240	1000~40000	6938.4	-37.72	≤-27	PASS
11AX20-CDD	Ant3	5240	30~1000	959.12	-45	≤-27	PASS
11AX20-CDD	Ant3	5240	1000~40000	6982.6	-37.8	≤-27	PASS
11AX20-CDD	Ant1	5260	30~1000	888.24	-44.44	≤-27	PASS
11AX20-CDD	Ant1	5260	1000~40000	6996.9	-37.46	≤-27	PASS
11AX20-CDD	Ant2	5260	30~1000	709.19	-44.42	≤-27	PASS
11AX20-CDD	Ant2	5260	1000~40000	6865.6	-37.75	≤-27	PASS
11AX20-CDD	Ant3	5260	30~1000	509.8	-44.31	≤-27	PASS
11AX20-CDD	Ant3	5260	1000~40000	6996.9	-37.15	≤-27	PASS
11AX20-CDD	Ant1	5280	30~1000	889.8	-45.11	≤-27	PASS
11AX20-CDD	Ant1	5280	1000~40000	39997.4	-38.26	≤-27	PASS
11AX20-CDD	Ant2	5280	30~1000	893.64	-44.42	≤-27	PASS
11AX20-CDD	Ant2	5280	1000~40000	6798	-37.75	≤-27	PASS
11AX20-CDD	Ant3	5280	30~1000	889.34	-45.03	≤-27	PASS
11AX20-CDD	Ant3	5280	1000~40000	6825.3	-37.46	≤-27	PASS
11AX20-CDD	Ant1	5320	30~1000	511.67	-44.9	≤-27	PASS
11AX20-CDD	Ant1	5320	1000~40000	6995.6	-37.82	≤-27	PASS
11AX20-CDD	Ant2	5320	30~1000	861.25	-44.62	≤-27	PASS
11AX20-CDD	Ant2	5320	1000~40000	39997.4	-37.52	≤-27	PASS
11AX20-CDD	Ant3	5320	30~1000	706.25	-43.22	≤-27	PASS
11AX20-CDD	Ant3	5320	1000~40000	6978.7	-37.28	≤-27	PASS
11AX20-CDD	Ant1	5500	30~1000	861.47	-42.5	≤-27	PASS
11AX20-CDD	Ant1	5500	1000~40000	6790.2	-37.71	≤-27	PASS


11AX20-CDD	Ant2	5500	30~1000	705.47	-45.24	≤-27	PASS
11AX20-CDD	Ant2	5500	1000~40000	6986.5	-36.84	≤-27	PASS
11AX20-CDD	Ant3	5500	30~1000	958.83	-43.98	≤-27	PASS
11AX20-CDD	Ant3	5500	1000~40000	6876	-38.09	≤-27	PASS
11AX20-CDD	Ant1	5580	30~1000	860.05	-44.82	≤-27	PASS
11AX20-CDD	Ant1	5580	1000~40000	6903.3	-37.53	≤-27	PASS
11AX20-CDD	Ant2	5580	30~1000	870.17	-44.64	≤-27	PASS
11AX20-CDD	Ant2	5580	1000~40000	6964.4	-37.92	≤-27	PASS
11AX20-CDD	Ant3	5580	30~1000	958.63	-44.8	≤-27	PASS
11AX20-CDD	Ant3	5580	1000~40000	6916.3	-37.49	≤-27	PASS
11AX20-CDD	Ant1	5720	30~1000	889.93	-44.76	≤-27	PASS
11AX20-CDD	Ant1	5720	1000~40000	6972.2	-36.21	≤-27	PASS
11AX20-CDD	Ant2	5720	30~1000	963.09	-44.01	≤-27	PASS
11AX20-CDD	Ant2	5720	1000~40000	6993	-37.48	≤-27	PASS
11AX20-CDD	Ant3	5720	30~1000	898.23	-44.1	≤-27	PASS
11AX20-CDD	Ant3	5720	1000~40000	6522.4	-36.86	≤-27	PASS
11AX20-CDD	Ant1	5745	30~1000	958.57	-45.51	≤-27	PASS
11AX20-CDD	Ant1	5745	1000~40000	6976.1	-36.45	≤-27	PASS
11AX20-CDD	Ant2	5745	30~1000	508.79	-45.7	≤-27	PASS
11AX20-CDD	Ant2	5745	1000~40000	6928	-37.27	≤-27	PASS
11AX20-CDD	Ant3	5745	30~1000	888.02	-43.84	≤-27	PASS
11AX20-CDD	Ant3	5745	1000~40000	6512	-37.28	≤-27	PASS
11AX20-CDD	Ant1	5785	30~1000	705.57	-43.69	≤-27	PASS
11AX20-CDD	Ant1	5785	1000~40000	6792.8	-37.38	≤-27	PASS
11AX20-CDD	Ant2	5785	30~1000	893.87	-43.89	≤-27	PASS
11AX20-CDD	Ant2	5785	1000~40000	6938.4	-36.82	≤-27	PASS
11AX20-CDD	Ant3	5785	30~1000	963.25	-44.8	≤-27	PASS
11AX20-CDD	Ant3	5785	1000~40000	6983.9	-36.3	≤-27	PASS
11AX20-CDD	Ant1	5825	30~1000	118.19	-44.14	≤-27	PASS
11AX20-CDD	Ant1	5825	1000~40000	6999.5	-36.98	≤-27	PASS
11AX20-CDD	Ant2	5825	30~1000	120.35	-44.95	≤-27	PASS
11AX20-CDD	Ant2	5825	1000~40000	6959.2	-37.38	≤-27	PASS
11AX20-CDD	Ant3	5825	30~1000	961.93	-44.89	≤-27	PASS
11AX20-CDD	Ant3	5825	1000~40000	38973	-37.63	≤-27	PASS
11AX40-CDD	Ant1	5190	30~1000	959.47	-45.28	≤-27	PASS
11AX40-CDD	Ant1	5190	1000~40000	6972.2	-37.97	≤-27	PASS
11AX40-CDD	Ant2	5190	30~1000	864.77	-45.44	≤-27	PASS
11AX40-CDD	Ant2	5190	1000~40000	6972.2	-38.36	≤-27	PASS
11AX40-CDD	Ant3	5190	30~1000	708.99	-44.23	≤-27	PASS
11AX40-CDD	Ant3	5190	1000~40000	6900.7	-37.51	≤-27	PASS
11AX40-CDD	Ant1	5230	30~1000	889.12	-45.4	≤-27	PASS
11AX40-CDD	Ant1	5230	1000~40000	6995.6	-37.56	≤-27	PASS
11AX40-CDD	Ant2	5230	30~1000	889.83	-43.68	≤-27	PASS
11AX40-CDD	Ant2	5230	1000~40000	6938.4	-38.3	≤-27	PASS
11AX40-CDD	Ant3	5230	30~1000	958.24	-45.1	≤-27	PASS
11AX40-CDD	Ant3	5230	1000~40000	6987.8	-37.43	≤-27	PASS
11AX40-CDD	Ant1	5270	30~1000	861.34	-45.22	≤-27	PASS
11AX40-CDD	Ant1	5270	1000~40000	6635.5	-36.99	≤-27	PASS
11AX40-CDD	Ant2	5270	30~1000	821.54	-45.62	≤-27	PASS
11AX40-CDD	Ant2	5270	1000~40000	6922.8	-36.8	≤-27	PASS
11AX40-CDD	Ant3	5270	30~1000	888.96	-45.17	≤-27	PASS
11AX40-CDD	Ant3	5270	1000~40000	6808.4	-37.3	≤-27	PASS
11AX40-CDD	Ant1	5310	30~1000	961.12	-44.29	≤-27	PASS
11AX40-CDD	Ant1	5310	1000~40000	6913.7	-38.13	≤-27	PASS
11AX40-CDD	Ant2	5310	30~1000	960.67	-44.17	≤-27	PASS
11AX40-CDD	Ant2	5310	1000~40000	6847.4	-37.64	≤-27	PASS
11AX40-CDD	Ant3	5310	30~1000	860.44	-44.45	≤-27	PASS
11AX40-CDD	Ant3	5310	1000~40000	6986.5	-37.24	≤-27	PASS
11AX40-CDD	Ant1	5510	30~1000	889.18	-44.56	≤-27	PASS
11AX40-CDD	Ant1	5510	1000~40000	6970.9	-38.16	≤-27	PASS
11AX40-CDD	Ant2	5510	30~1000	890.12	-43.86	≤-27	PASS
11AX40-CDD	Ant2	5510	1000~40000	6896.8	-37.42	≤-27	PASS
11AX40-CDD	Ant3	5510	30~1000	961.38	-44.7	≤-27	PASS
11AX40-CDD	Ant3	5510	1000~40000	6800.6	-37.4	≤-27	PASS
11AX40-CDD	Ant1	5550	30~1000	888.96	-44.42	≤-27	PASS
11AX40-CDD	Ant1	5550	1000~40000	6983.9	-36.9	≤-27	PASS
11AX40-CDD	Ant2	5550	30~1000	861.38	-42.71	≤-27	PASS
11AX40-CDD	Ant2	5550	1000~40000	39278.5	-37.52	≤-27	PASS
11AX40-CDD	Ant3	5550	30~1000	861.63	-43.93	≤-27	PASS
11AX40-CDD	Ant3	5550	1000~40000	6955.3	-36.42	≤-27	PASS

11AX40-CDD	Ant1	5710	30~1000	860.99	-43.99	≤-27	PASS
11AX40-CDD	Ant1	5710	1000~40000	6857.8	-37.42	≤-27	PASS
11AX40-CDD	Ant2	5710	30~1000	962.09	-43.63	≤-27	PASS
11AX40-CDD	Ant2	5710	1000~40000	6956.6	-36.5	≤-27	PASS
11AX40-CDD	Ant3	5710	30~1000	803.82	-43.76	≤-27	PASS
11AX40-CDD	Ant3	5710	1000~40000	6956.6	-37.31	≤-27	PASS
11AX40-CDD	Ant1	5755	30~1000	863.22	-44.42	≤-27	PASS
11AX40-CDD	Ant1	5755	1000~40000	6892.9	-37.2	≤-27	PASS
11AX40-CDD	Ant2	5755	30~1000	890.44	-44.52	≤-27	PASS
11AX40-CDD	Ant2	5755	1000~40000	6978.7	-37.48	≤-27	PASS
11AX40-CDD	Ant3	5755	30~1000	888.41	-44.66	≤-27	PASS
11AX40-CDD	Ant3	5755	1000~40000	6920.2	-37.16	≤-27	PASS
11AX40-CDD	Ant1	5795	30~1000	860.21	-45.5	≤-27	PASS
11AX40-CDD	Ant1	5795	1000~40000	6994.3	-37.57	≤-27	PASS
11AX40-CDD	Ant2	5795	30~1000	897.1	-43.77	≤-27	PASS
11AX40-CDD	Ant2	5795	1000~40000	6980	-37.95	≤-27	PASS
11AX40-CDD	Ant3	5795	30~1000	118.7	-44.71	≤-27	PASS
11AX40-CDD	Ant3	5795	1000~40000	6917.6	-37.89	≤-27	PASS
11AX80-CDD	Ant1	5210	30~1000	861.7	-45.12	≤-27	PASS
11AX80-CDD	Ant1	5210	1000~40000	6743.4	-38.44	≤-27	PASS
11AX80-CDD	Ant2	5210	30~1000	867.75	-46.24	≤-27	PASS
11AX80-CDD	Ant2	5210	1000~40000	39996.1	-38.36	≤-27	PASS
11AX80-CDD	Ant3	5210	30~1000	710.55	-45.24	≤-27	PASS
11AX80-CDD	Ant3	5210	1000~40000	6943.6	-38.24	≤-27	PASS
11AX80-CDD	Ant1	5290	30~1000	889.76	-42.11	≤-27	PASS
11AX80-CDD	Ant1	5290	1000~40000	6929.3	-37.75	≤-27	PASS
11AX80-CDD	Ant2	5290	30~1000	515.55	-44.75	≤-27	PASS
11AX80-CDD	Ant2	5290	1000~40000	6965.7	-37.53	≤-27	PASS
11AX80-CDD	Ant3	5290	30~1000	963.71	-45.46	≤-27	PASS
11AX80-CDD	Ant3	5290	1000~40000	6995.6	-37.54	≤-27	PASS
11AX80-CDD	Ant1	5530	30~1000	888.66	-43.68	≤-27	PASS
11AX80-CDD	Ant1	5530	1000~40000	39958.4	-36.93	≤-27	PASS
11AX80-CDD	Ant2	5530	30~1000	889.8	-44.35	≤-27	PASS
11AX80-CDD	Ant2	5530	1000~40000	6972.2	-36.95	≤-27	PASS
11AX80-CDD	Ant3	5530	30~1000	860.63	-44.95	≤-27	PASS
11AX80-CDD	Ant3	5530	1000~40000	6952.7	-37.47	≤-27	PASS
11AX80-CDD	Ant1	5610	30~1000	862.51	-43.2	≤-27	PASS
11AX80-CDD	Ant1	5610	1000~40000	6994.3	-37.47	≤-27	PASS
11AX80-CDD	Ant2	5610	30~1000	896.07	-44.91	≤-27	PASS
11AX80-CDD	Ant2	5610	1000~40000	6664.1	-38.01	≤-27	PASS
11AX80-CDD	Ant3	5610	30~1000	962.38	-43.87	≤-27	PASS
11AX80-CDD	Ant3	5610	1000~40000	6933.2	-37.7	≤-27	PASS
11AX80-CDD	Ant1	5690	30~1000	888.24	-42.71	≤-27	PASS
11AX80-CDD	Ant1	5690	1000~40000	6842.2	-37.4	≤-27	PASS
11AX80-CDD	Ant2	5690	30~1000	959.12	-43.16	≤-27	PASS
11AX80-CDD	Ant2	5690	1000~40000	6987.8	-37.33	≤-27	PASS
11AX80-CDD	Ant3	5690	30~1000	862.6	-42.21	≤-27	PASS
11AX80-CDD	Ant3	5690	1000~40000	6965.7	-35.76	≤-27	PASS
11AX80-CDD	Ant1	5775	30~1000	961.74	-44.77	≤-27	PASS
11AX80-CDD	Ant1	5775	1000~40000	6835.7	-37.9	≤-27	PASS
11AX80-CDD	Ant2	5775	30~1000	741.07	-45.25	≤-27	PASS
11AX80-CDD	Ant2	5775	1000~40000	6996.9	-37.77	≤-27	PASS
11AX80-CDD	Ant3	5775	30~1000	509.34	-44.91	≤-27	PASS
11AX80-CDD	Ant3	5775	1000~40000	6913.7	-37.94	≤-27	PASS
11AX160-CDD	Ant1	5250	30~1000	711.71	-43.78	≤-27	PASS
11AX160-CDD	Ant1	5250	1000~40000	6941	-37.94	≤-27	PASS
11AX160-CDD	Ant2	5250	30~1000	709.64	-44.99	≤-27	PASS
11AX160-CDD	Ant2	5250	1000~40000	6844.8	-37.49	≤-27	PASS
11AX160-CDD	Ant3	5250	30~1000	889.21	-45.1	≤-27	PASS
11AX160-CDD	Ant3	5250	1000~40000	39984.4	-37.9	≤-27	PASS
11AX160-CDD	Ant1	5570	30~1000	860.47	-44.13	≤-27	PASS
11AX160-CDD	Ant1	5570	1000~40000	6911.1	-38.02	≤-27	PASS
11AX160-CDD	Ant2	5570	30~1000	859.89	-43.31	≤-27	PASS
11AX160-CDD	Ant2	5570	1000~40000	6973.5	-37.61	≤-27	PASS
11AX160-CDD	Ant3	5570	30~1000	862.02	-44.33	≤-27	PASS
11AX160-CDD	Ant3	5570	1000~40000	6944.9	-37.75	≤-27	PASS


7.2 Test Graphs

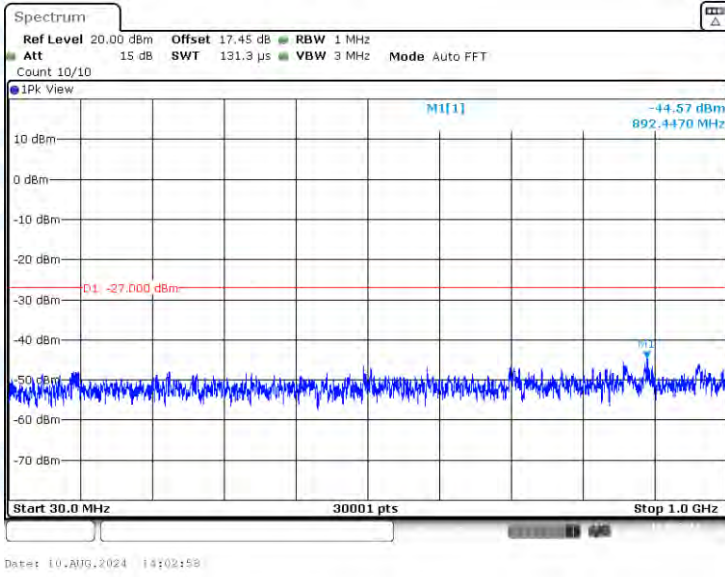


11A-Ant1-5180-30~1000-PASS

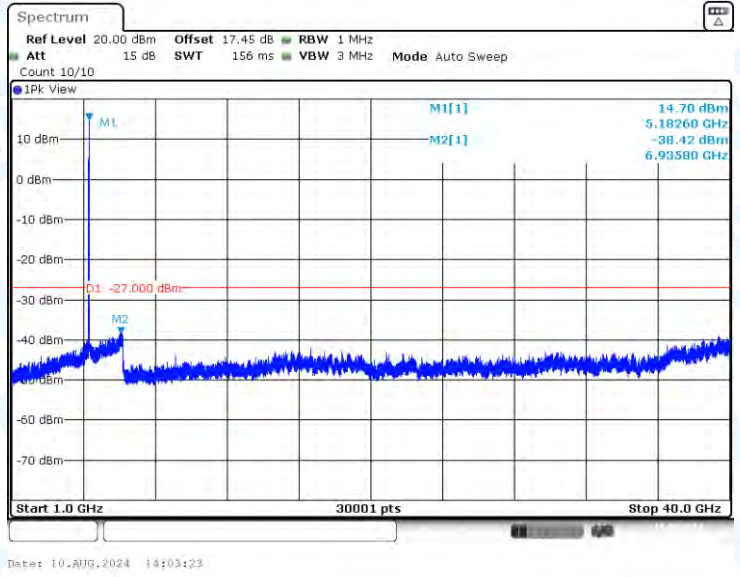


11A-Ant1-5180-1000~40000-PASS

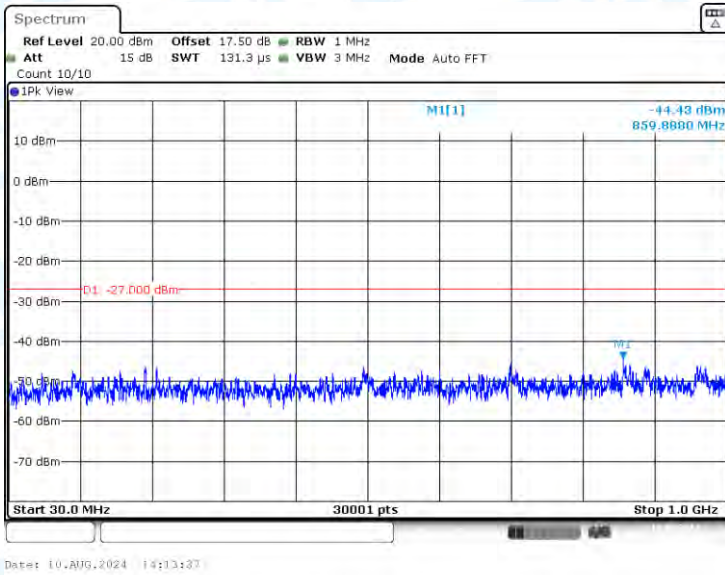


11A-Ant2-5180-30~1000-PASS

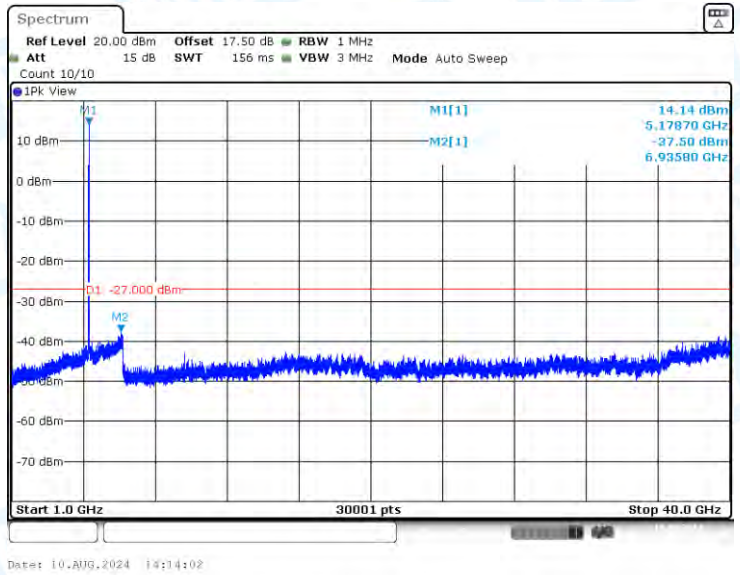


11A-Ant2-5180-1000~40000-PASS

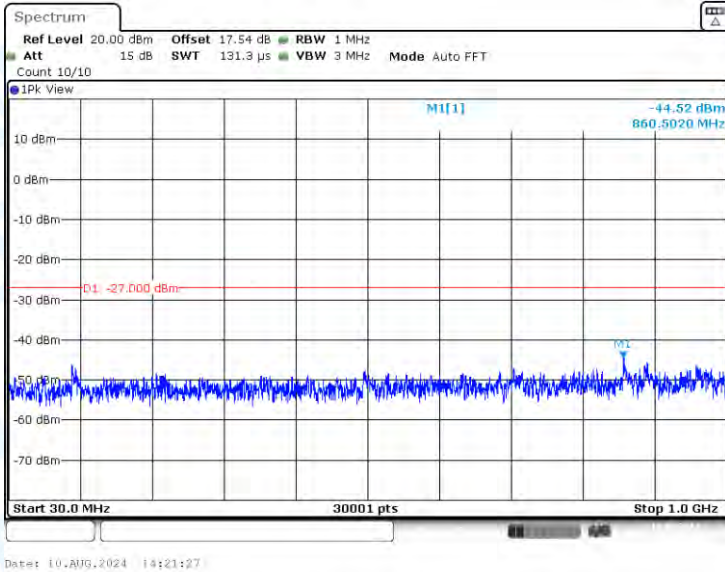


11A-Ant3-5180-30~1000-PASS

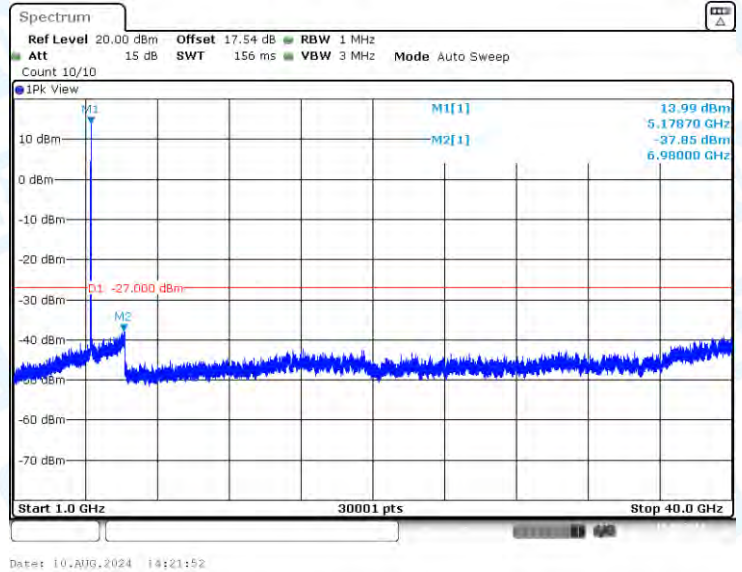



11A-Ant3-5180-1000~40000-PASS

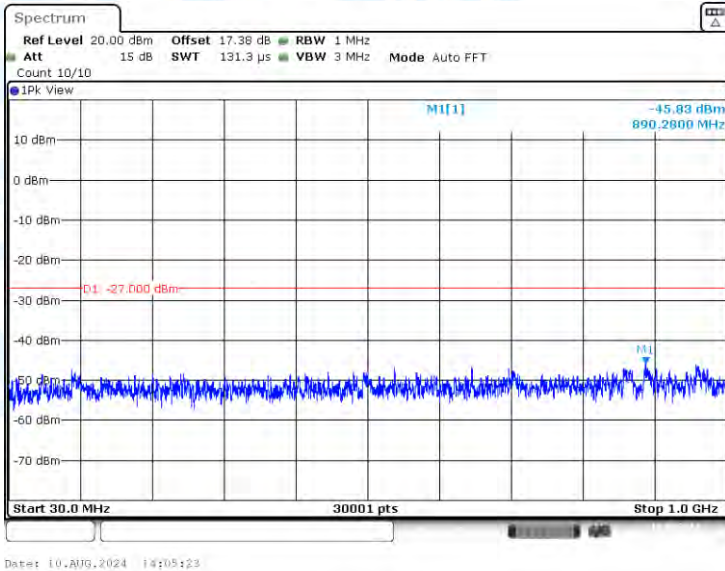


11A-Ant1-5200-30~1000-PASS

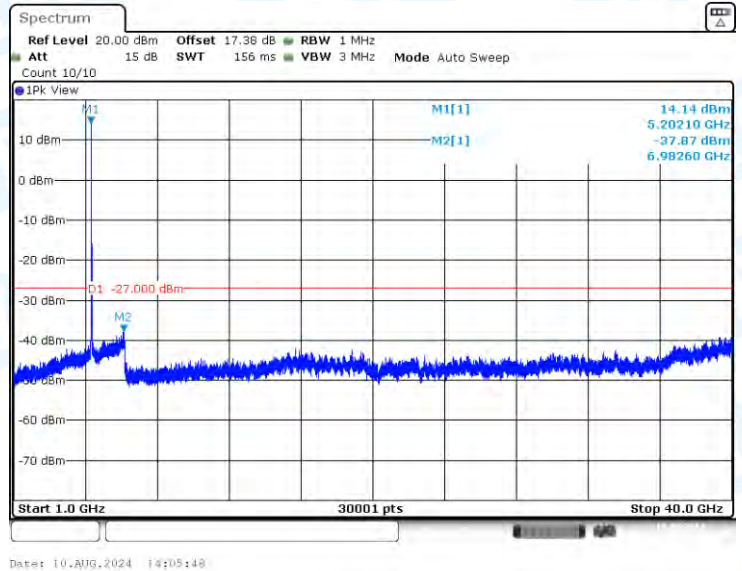


11A-Ant1-5200-1000~40000-PASS

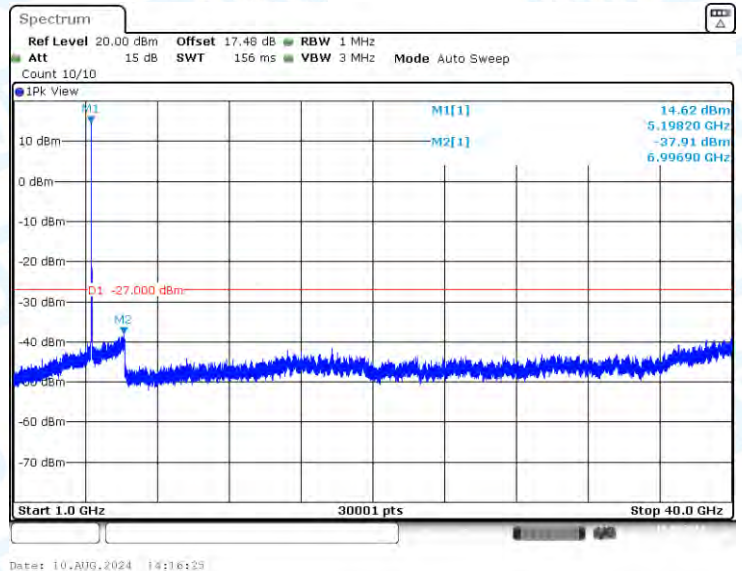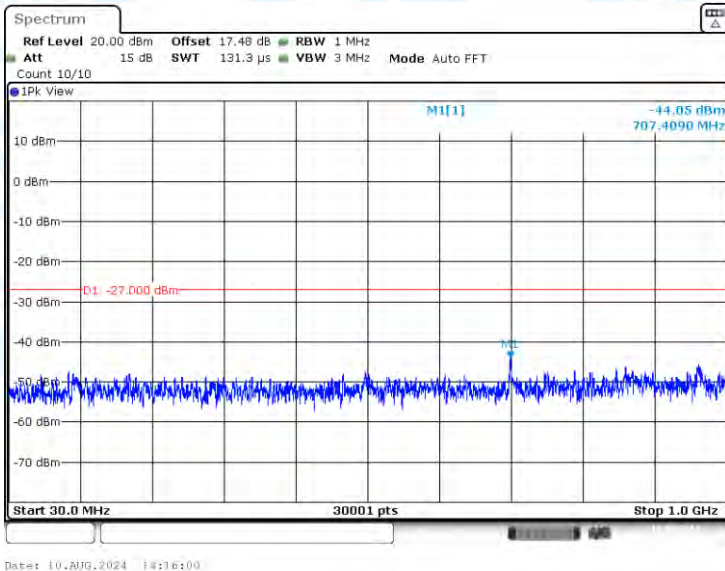


11A-Ant2-5200-30~1000-PASS

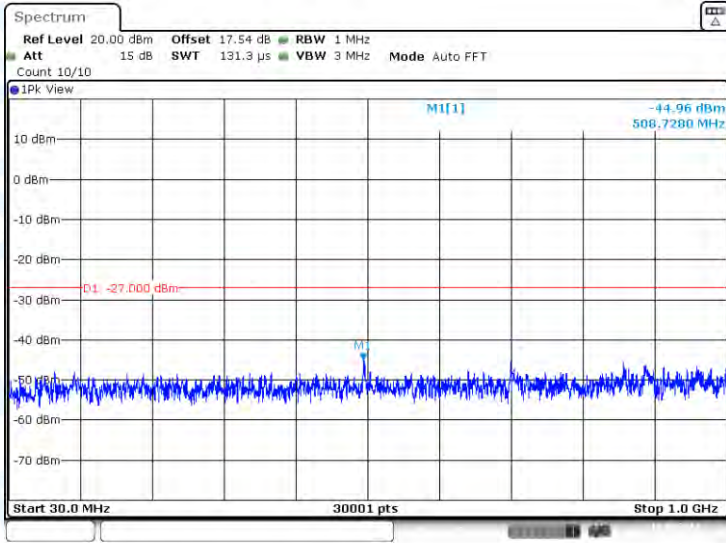


11A-Ant2-5200-1000~40000-PASS

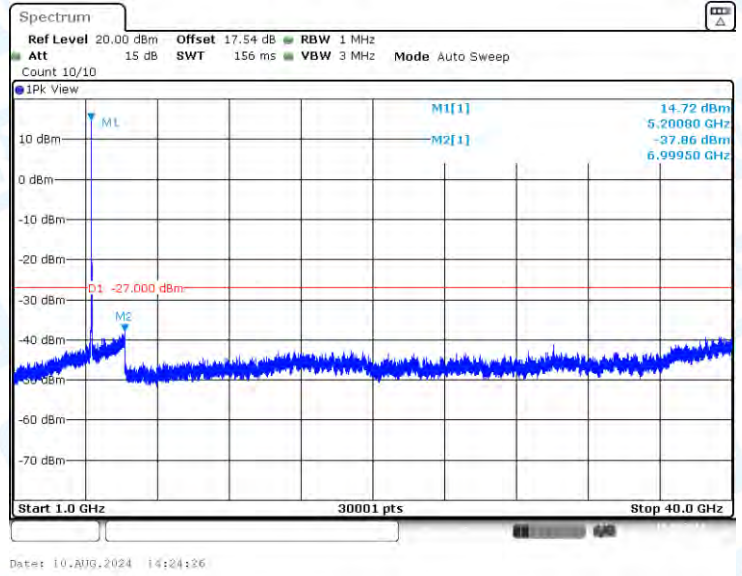

11A-Ant3-5200-30~1000-PASS

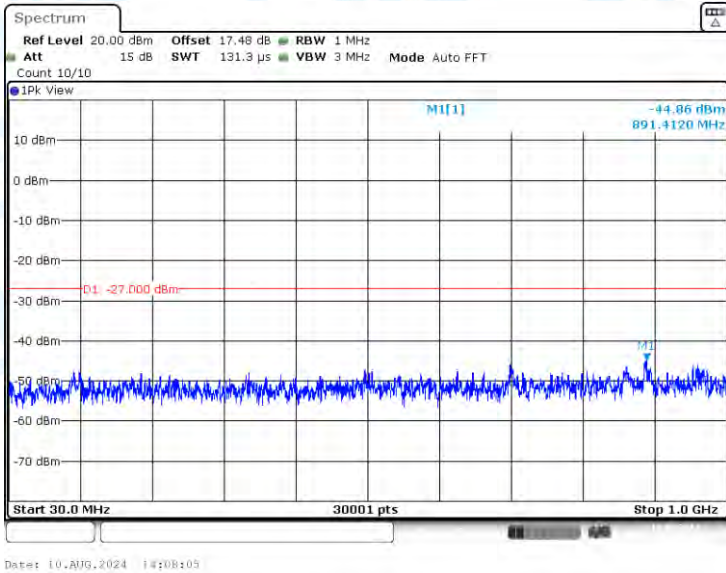


11A-Ant3-5200-1000~40000-PASS

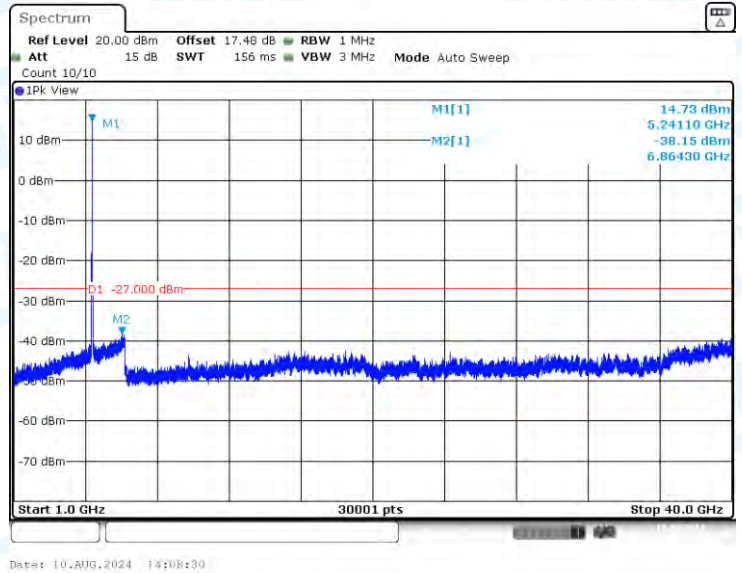


11A-Ant1-5240-30~1000-PASS


11A-Ant1-5240-1000~40000-PASS

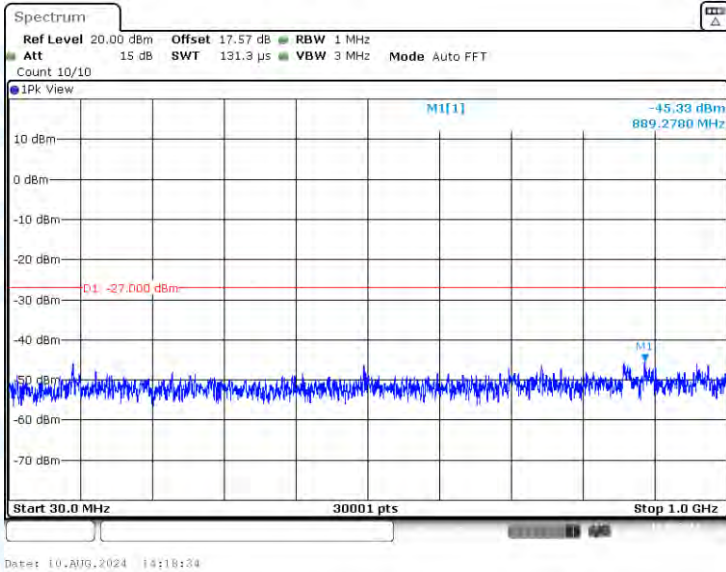


11A-Ant2-5240-30~1000-PASS

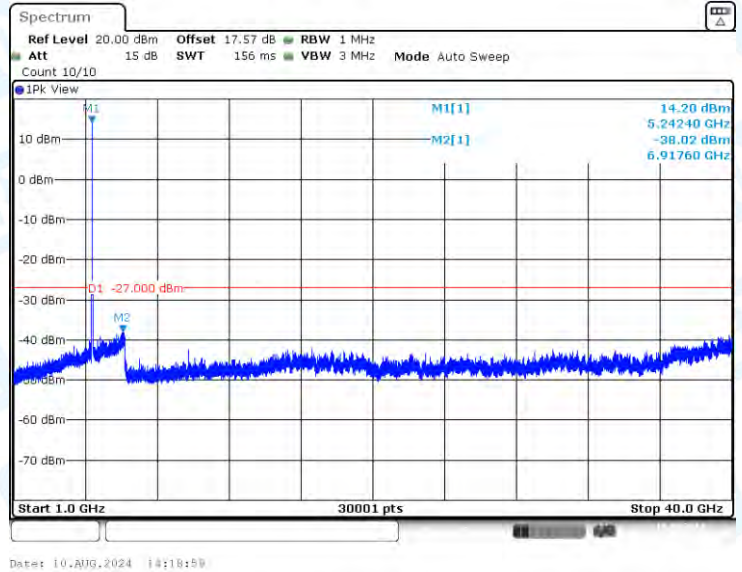



11A-Ant2-5240-1000~40000-PASS

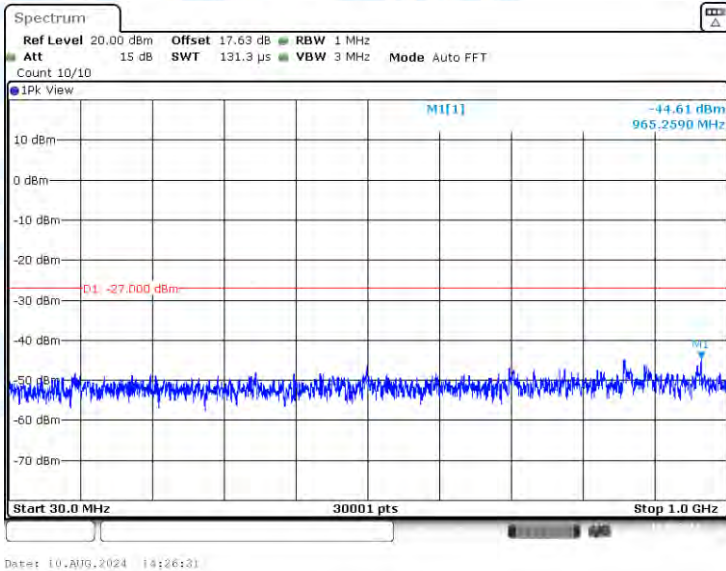


11A-Ant3-5240-30~1000-PASS

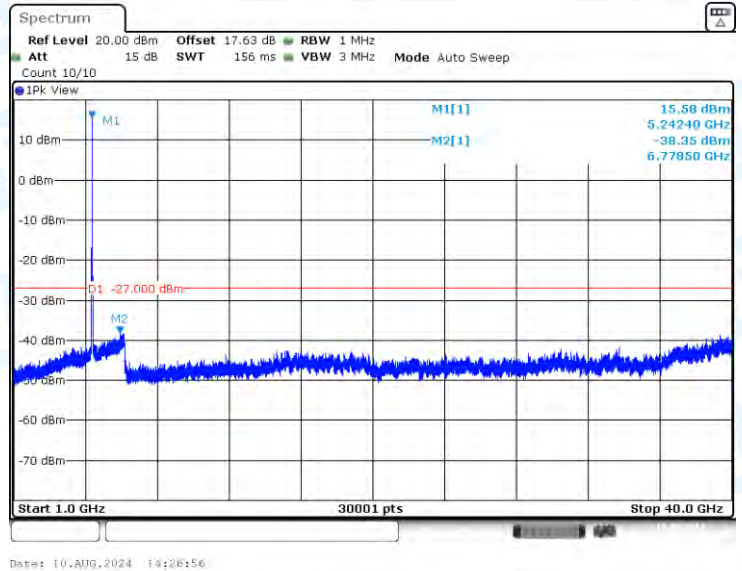

11A-Ant3-5240-1000~40000-PASS

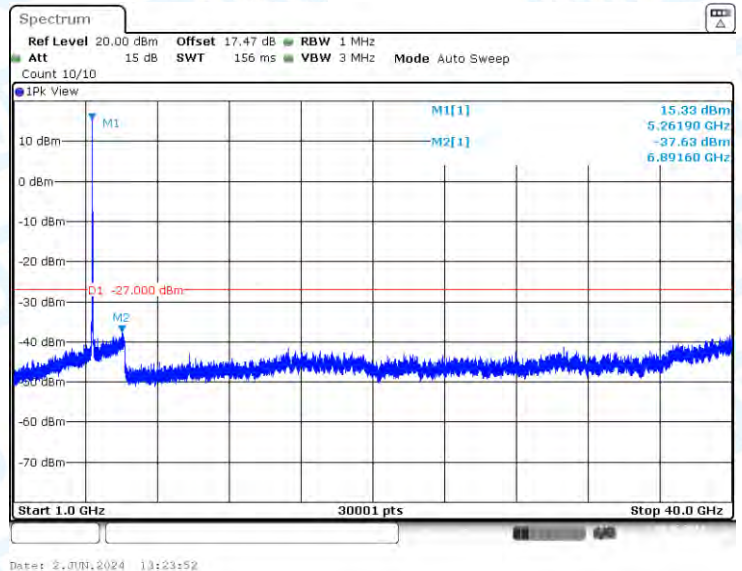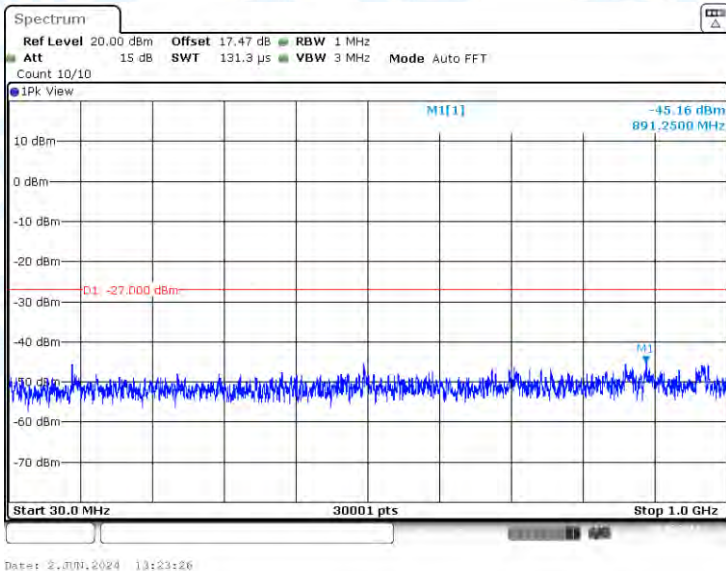


11A-Ant1-5260-30~1000-PASS

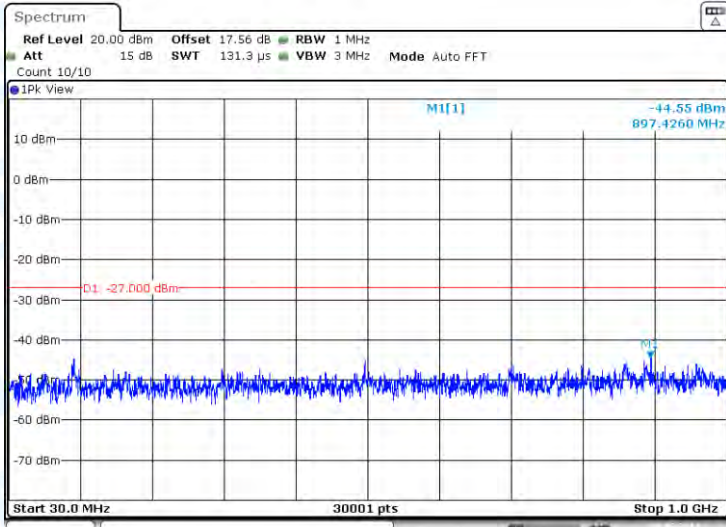


Date: 2 JUN 2024 13:25:11

11A-Ant1-5260-1000~40000-PASS

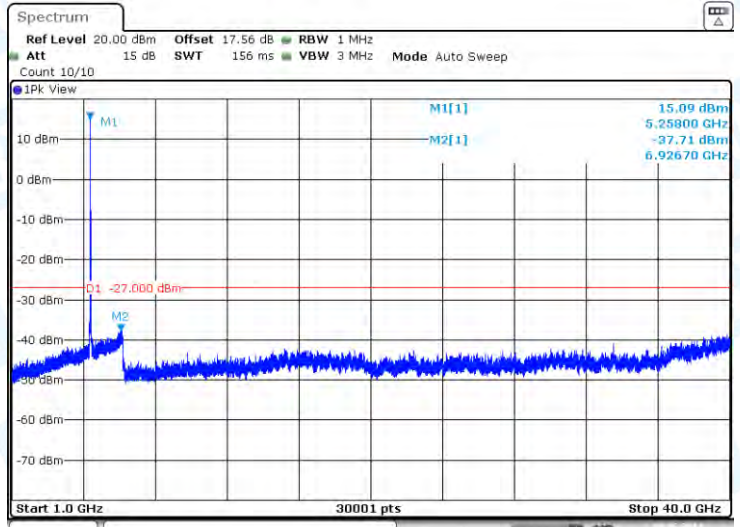


Date: 2 JUN 2024 13:25:36

11A-Ant2-5260-30~1000-PASS

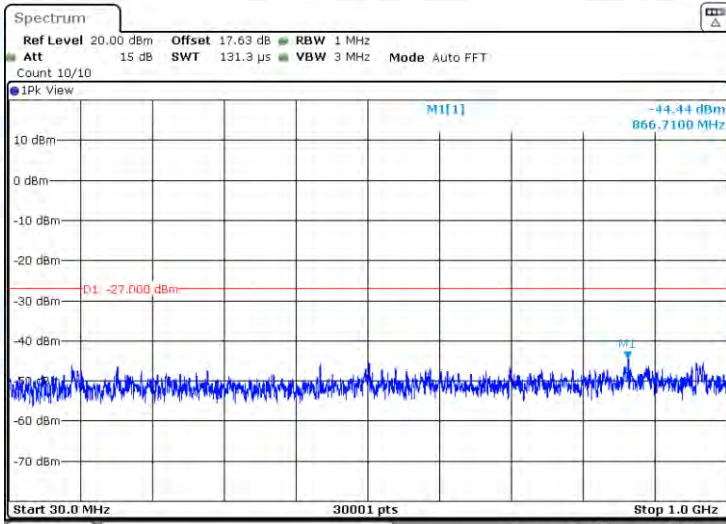

Date: 2 JUN 2024 13:26:57


11A-Ant2-5260-1000~40000-PASS

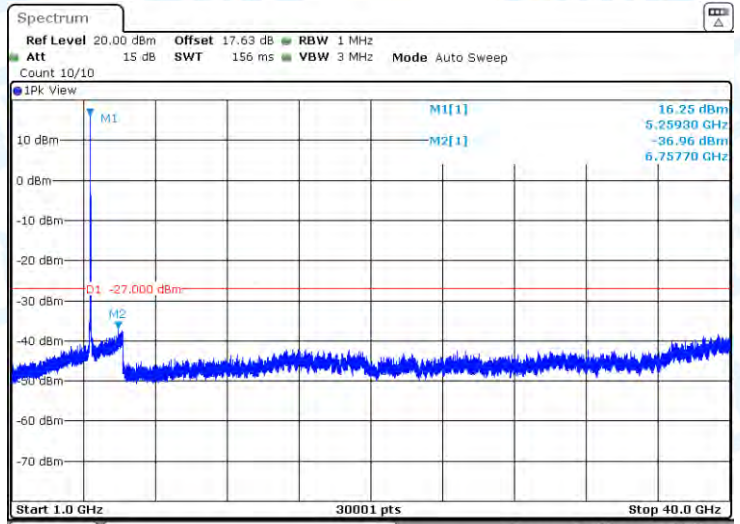


Date: 2 JUN 2024 13:27:22

11A-Ant3-5260-30~1000-PASS


11A-Ant3-5260-1000~40000-PASS

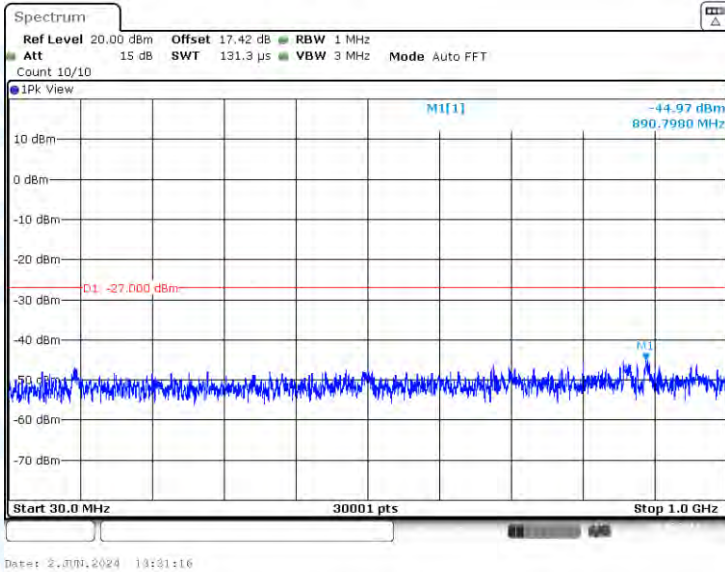


11A-Ant1-5280-30~1000-PASS

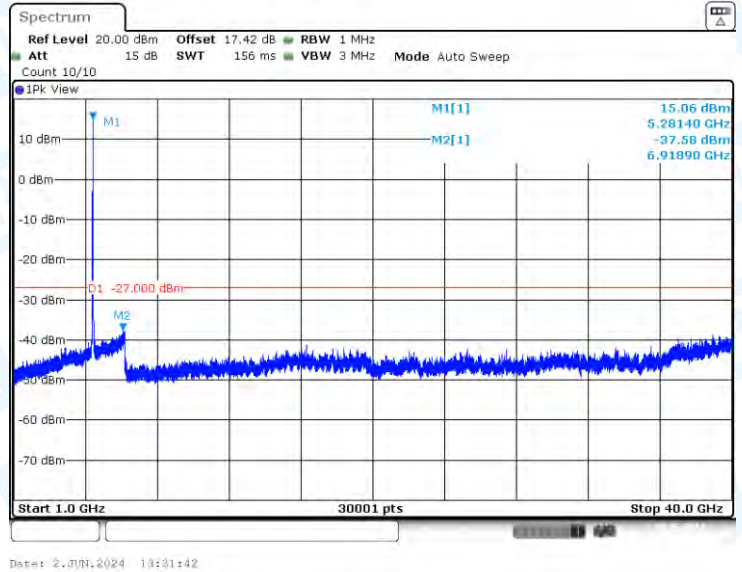



11A-Ant1-5280-1000~40000-PASS

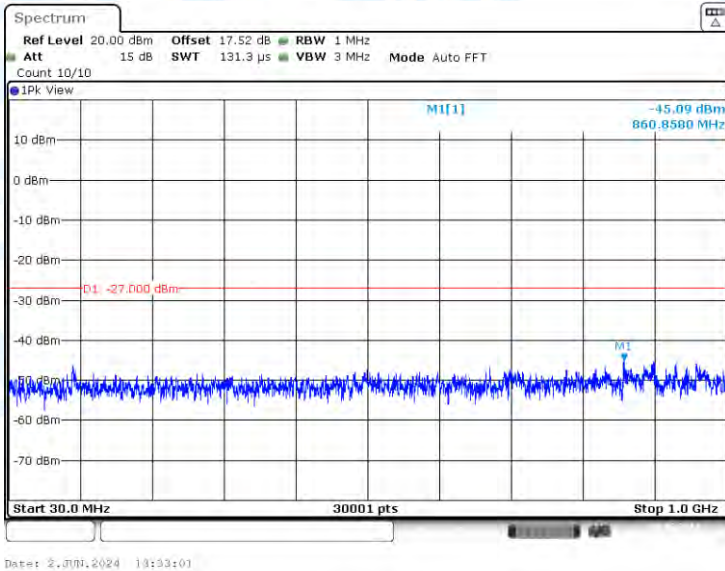


11A-Ant2-5280-30~1000-PASS

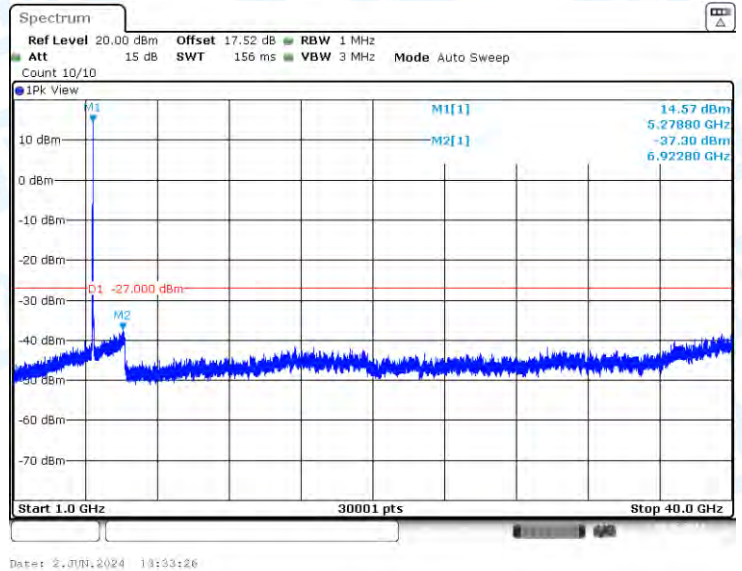


11A-Ant2-5280-1000~40000-PASS

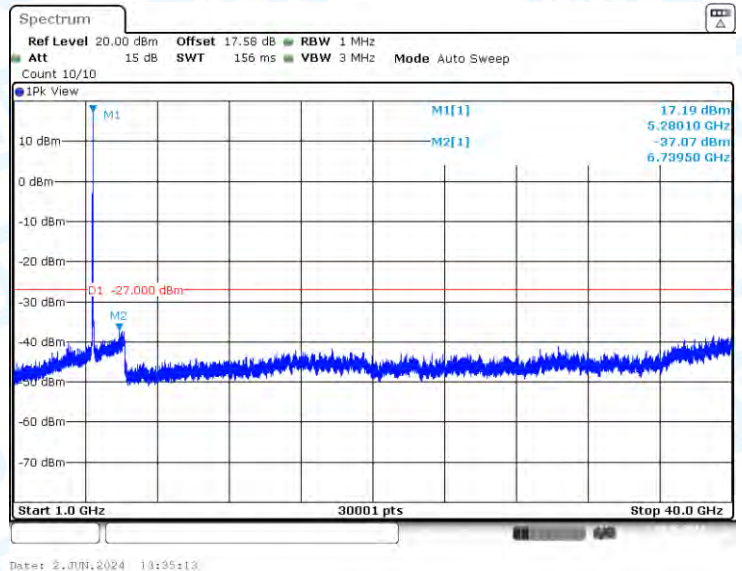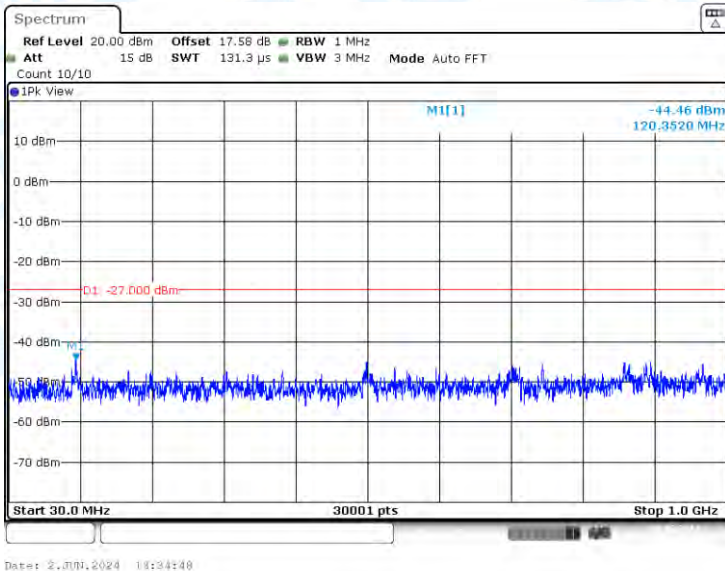


11A-Ant3-5280-30~1000-PASS

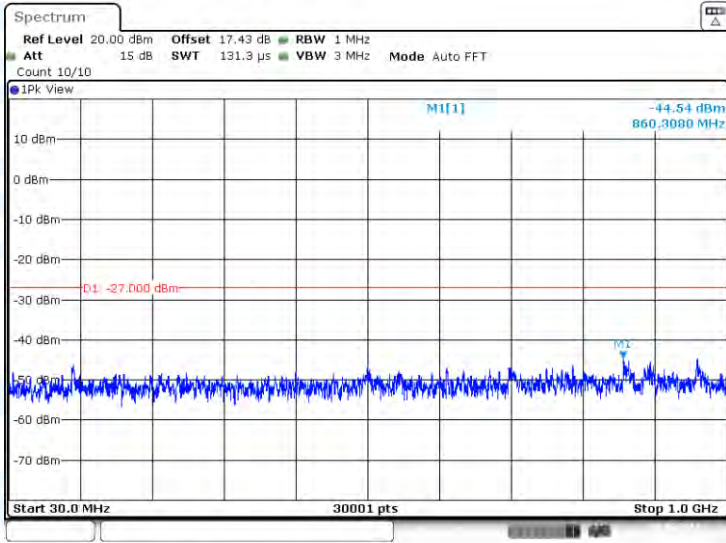


11A-Ant3-5280-1000~40000-PASS

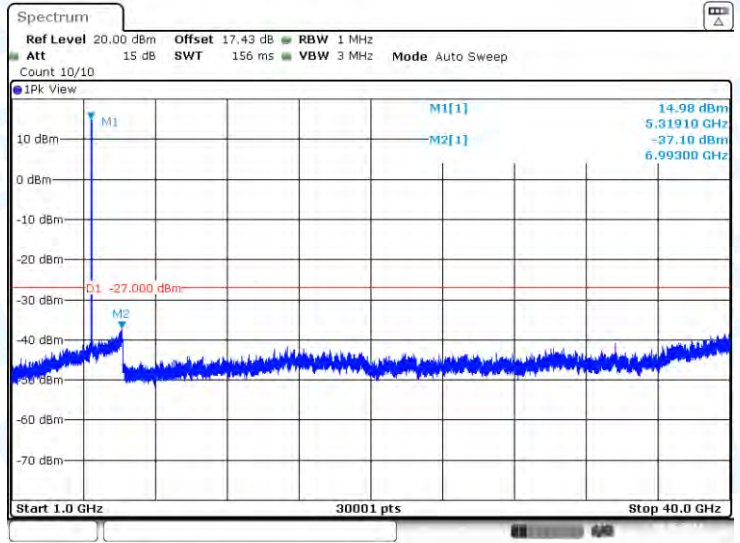

11A-Ant1-5320-30~1000-PASS

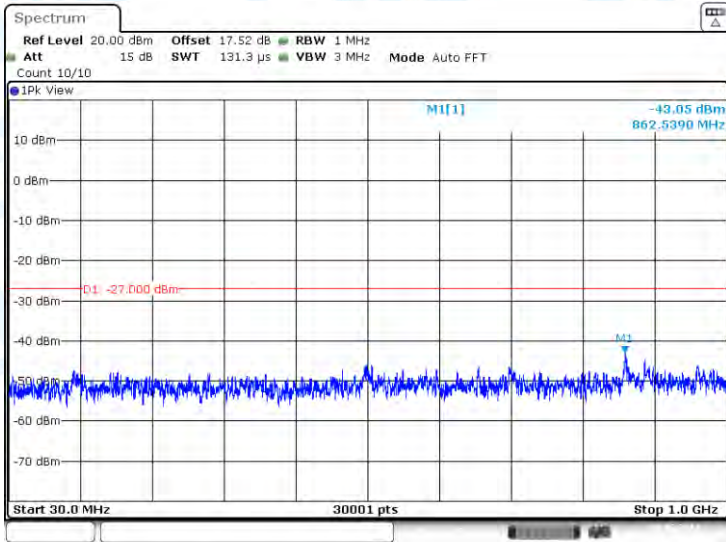

11A-Ant1-5320-1000~40000-PASS

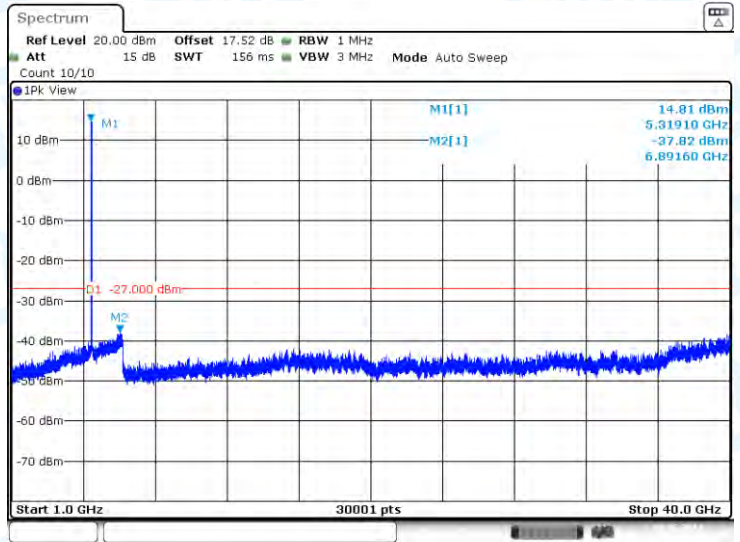


11A-Ant2-5320-30~1000-PASS




11A-Ant2-5320-1000~40000-PASS




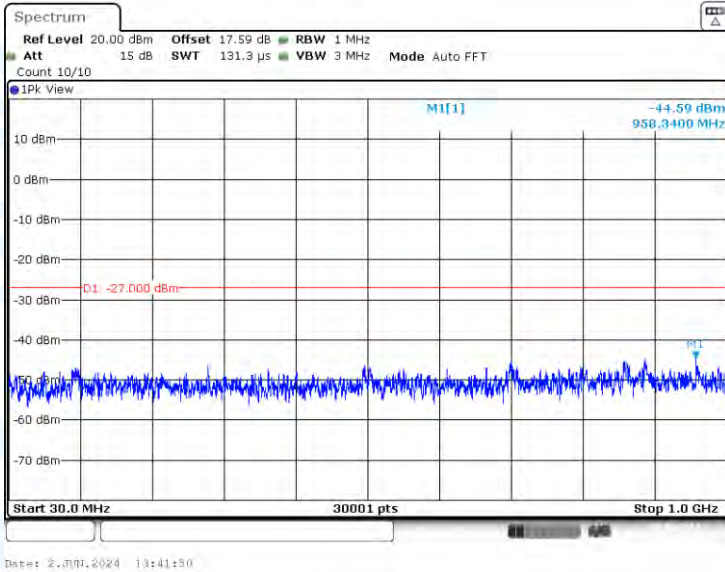


11A-Ant3-5320-30~1000-PASS

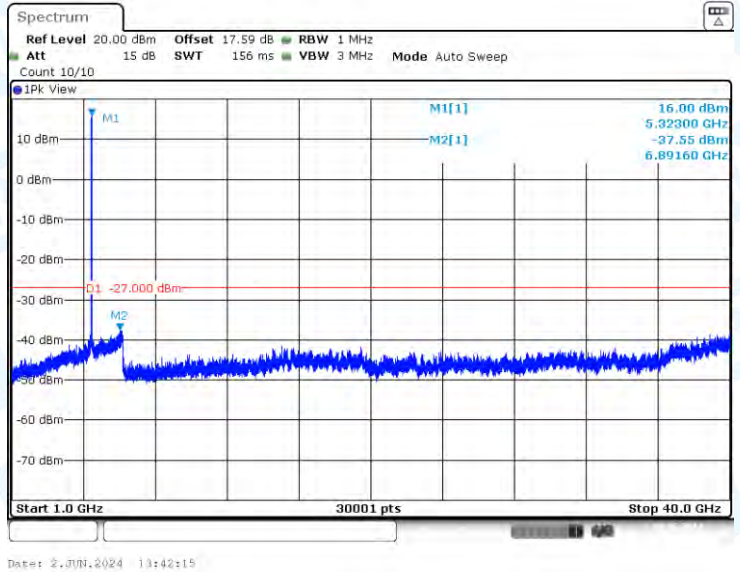

11A-Ant3-5320-1000~40000-PASS

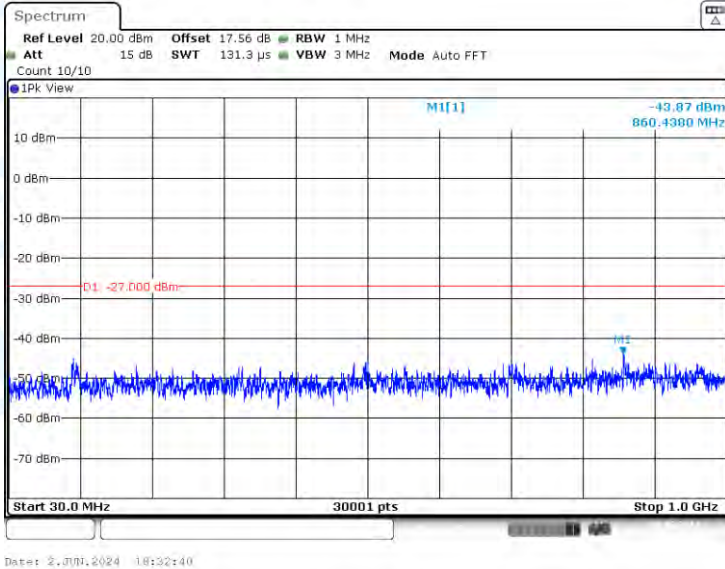

11A-Ant1-5500-30~1000-PASS

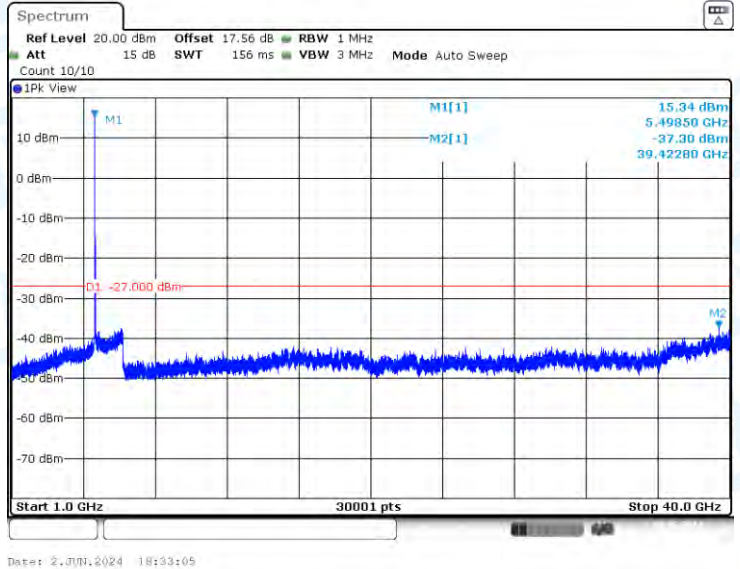

11A-Ant1-5500-1000~40000-PASS

