



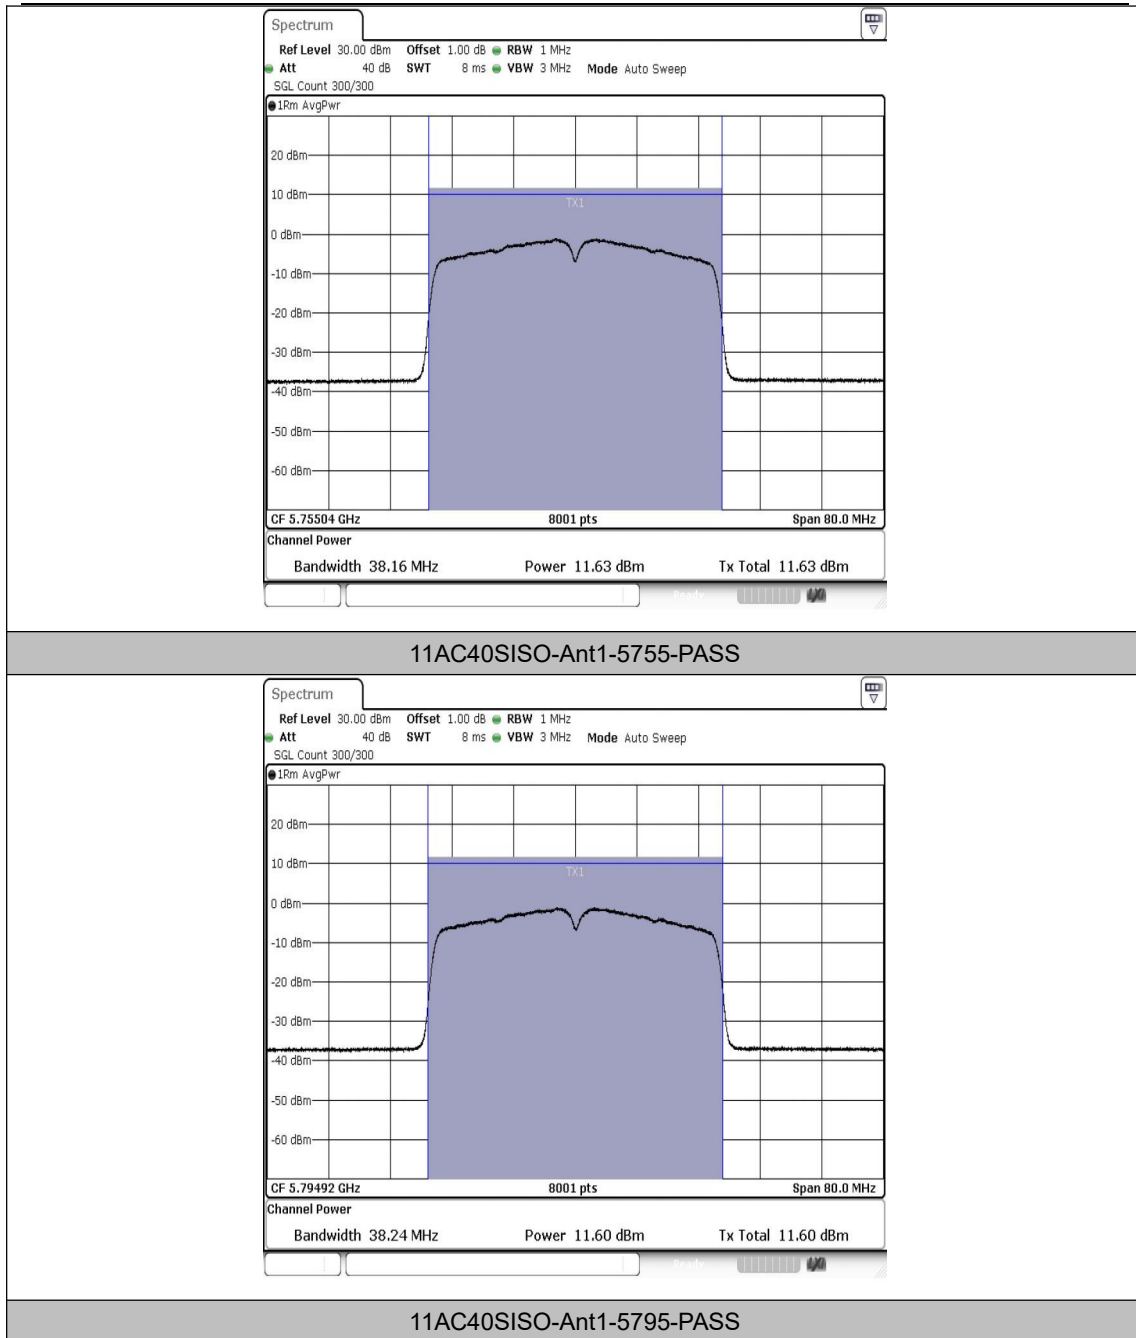

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com

 Hotline
400-003-0500
www.anbotech.com

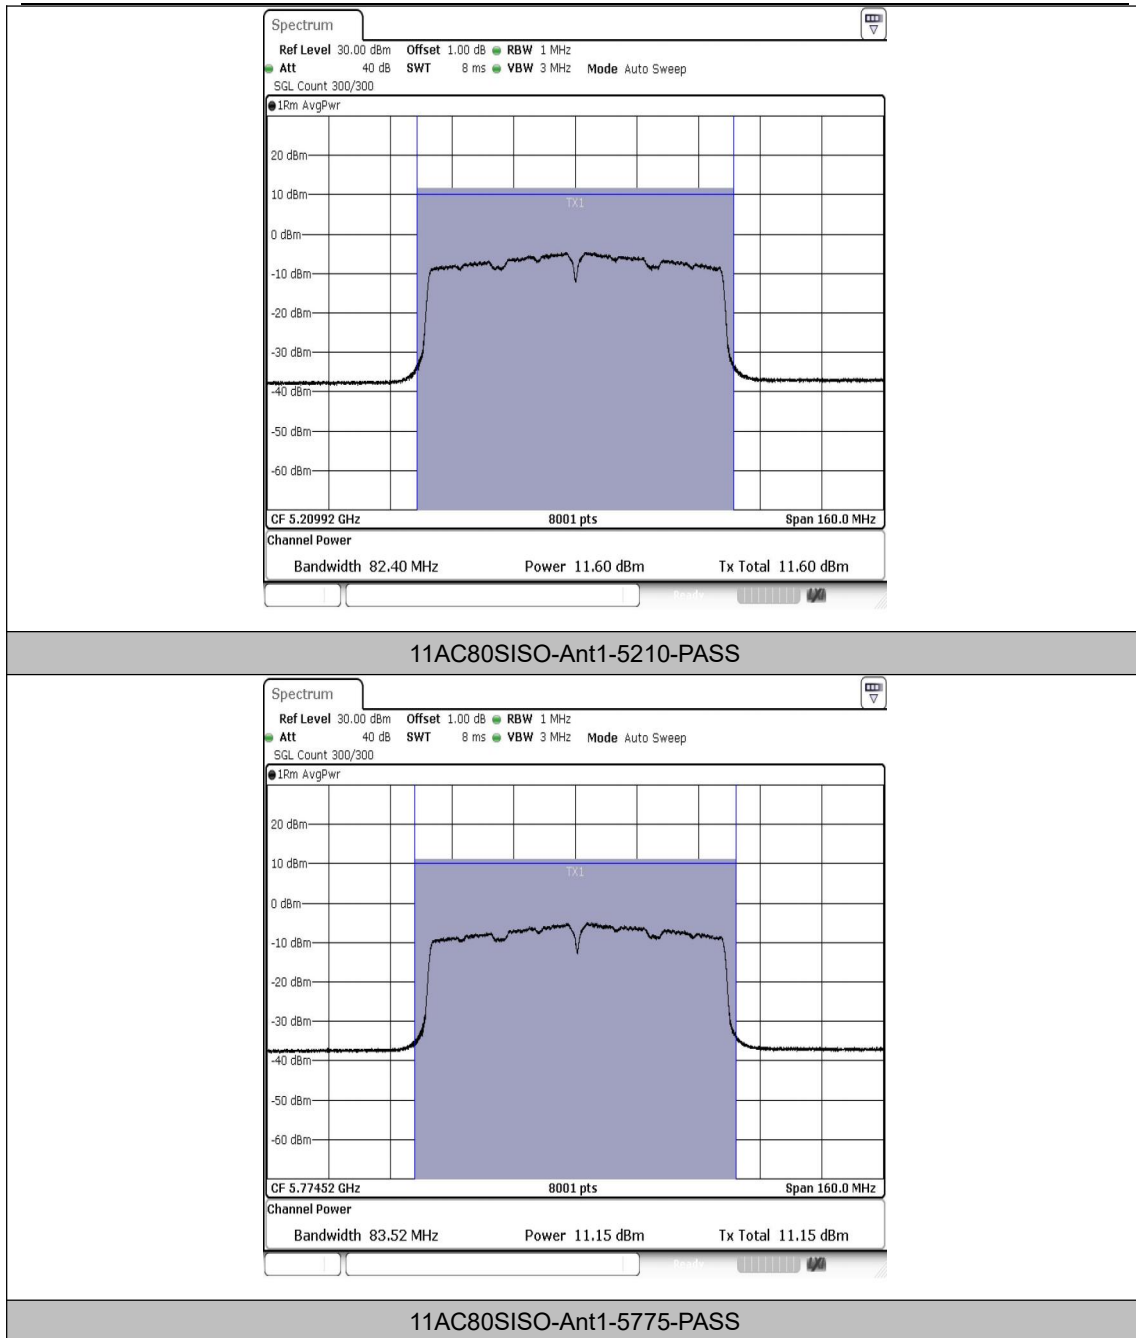

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com

 Hotline
400-003-0500
www.anbotech.com

Appendix D: Maximum Power Spectral Density

Test Result B1

Test Mode	Antenna	Frequency [MHz]	Reading Result[dBm/MHz]	DC Factor [dB]	Result [dBm/MHz]	Limit[dBm/MHz]	Verdict
11A	Ant1	5180	3.68	0.00	3.68	≤11.00	PASS
11A	Ant1	5200	3.86	0.00	3.86	≤11.00	PASS
11A	Ant1	5240	3.38	0.00	3.38	≤11.00	PASS
11N20SISO	Ant1	5180	3.27	0.00	3.27	≤11.00	PASS
11N20SISO	Ant1	5200	2.61	0.00	2.61	≤11.00	PASS
11N20SISO	Ant1	5240	2.69	0.00	2.69	≤11.00	PASS
11N40SISO	Ant1	5190	0.86	0.00	0.86	≤11.00	PASS
11N40SISO	Ant1	5230	0.07	0.00	0.07	≤11.00	PASS
11AC20SISO	Ant1	5180	2.69	0.00	2.69	≤11.00	PASS
11AC20SISO	Ant1	5200	3.24	0.00	3.24	≤11.00	PASS
11AC20SISO	Ant1	5240	2.95	0.00	2.95	≤11.00	PASS
11AC40SISO	Ant1	5190	0.89	0.00	0.89	≤11.00	PASS
11AC40SISO	Ant1	5230	-0.91	0.00	-0.91	≤11.00	PASS
11AC80SISO	Ant1	5210	-4.34	0.00	-4.34	≤11.00	PASS

Note: 1.The Duty Cycle Factor and cable loss and RBW Factor are compensated in the graph.




Test Result B4

Test Mode	Antenna	Frequency [MHz]	Reading Result[dB m/500KHz]	DC Factor [dB]	Result [dBm/500 KHz]	Limit[dBm /500KHz]	Verdict
11A	Ant1	5745	-0.73	0.00	-0.73	≤30.00	PASS
11A	Ant1	5785	-0.77	0.00	-0.77	≤30.00	PASS
11A	Ant1	5825	-0.66	0.00	-0.66	≤30.00	PASS
11N20SISO	Ant1	5745	-0.68	0.00	-0.68	≤30.00	PASS
11N20SISO	Ant1	5785	-0.72	0.00	-0.72	≤30.00	PASS
11N20SISO	Ant1	5825	-0.45	0.00	-0.45	≤30.00	PASS
11N40SISO	Ant1	5755	-3.27	0.00	-3.27	≤30.00	PASS
11N40SISO	Ant1	5795	-2.6	0.00	-2.60	≤30.00	PASS
11AC20SISO	Ant1	5745	0.08	0.00	0.08	≤30.00	PASS
11AC20SISO	Ant1	5785	-0.54	0.00	-0.54	≤30.00	PASS
11AC20SISO	Ant1	5825	-0.36	0.00	-0.36	≤30.00	PASS
11AC40SISO	Ant1	5755	-3.45	0.00	-3.45	≤30.00	PASS
11AC40SISO	Ant1	5795	-4.25	0.00	-4.25	≤30.00	PASS
11AC80SISO	Ant1	5775	-7.94	0.00	-7.94	≤30.00	PASS

Note: 1.The Duty Cycle Factor and cable loss and RBW Factor are compensated in the graph.




Test Graphs B1

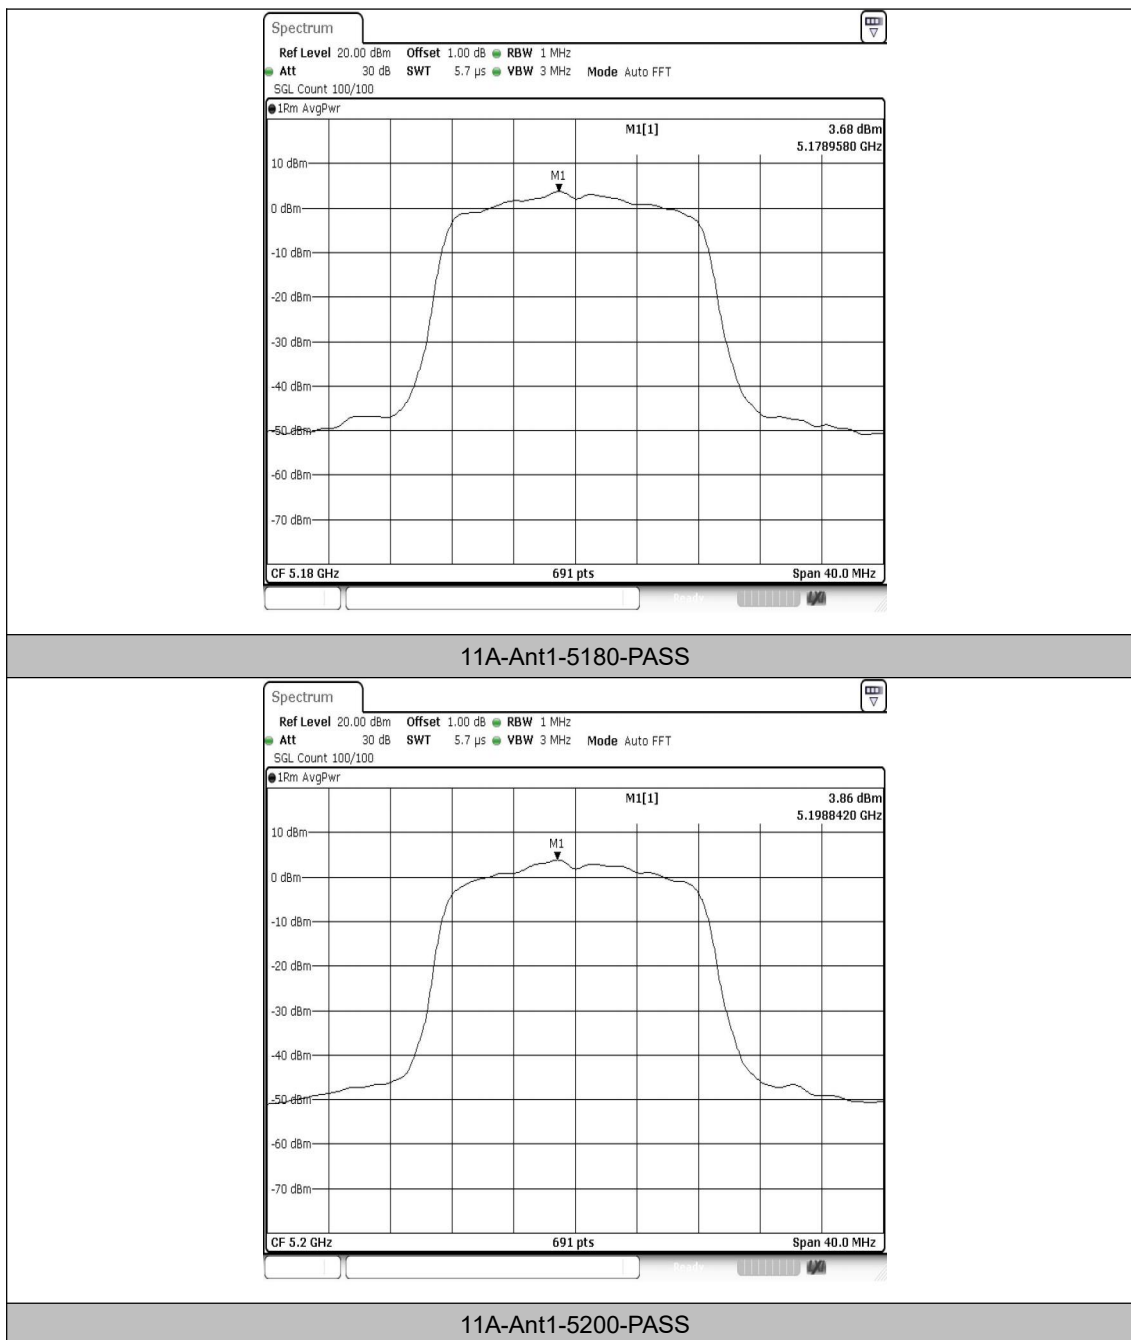

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

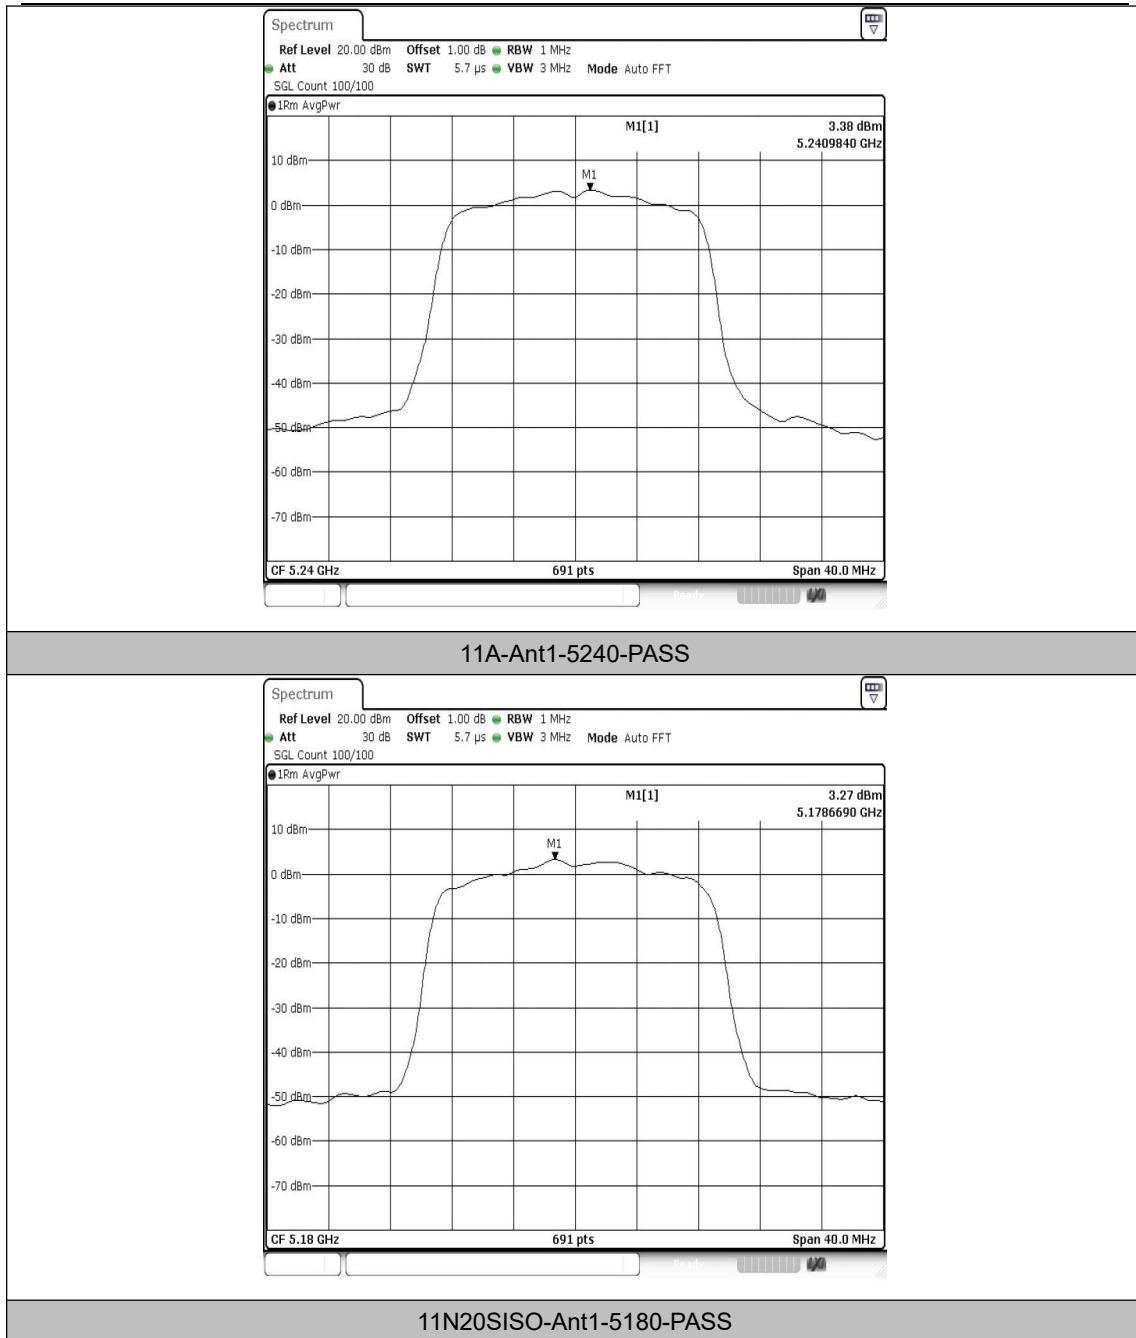

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

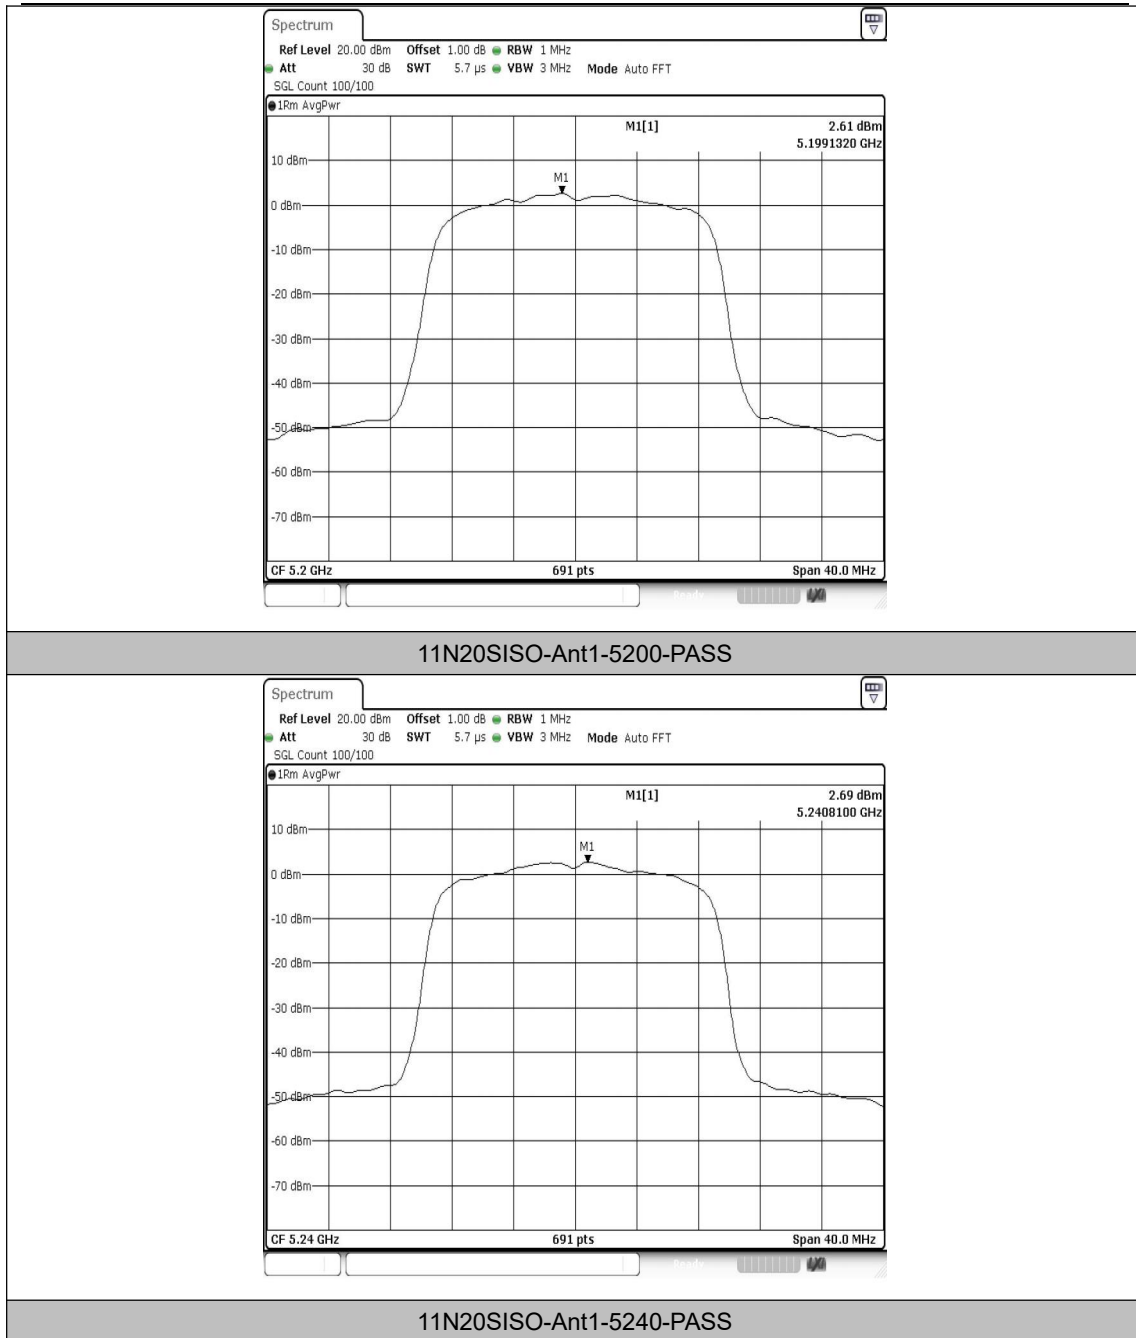

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

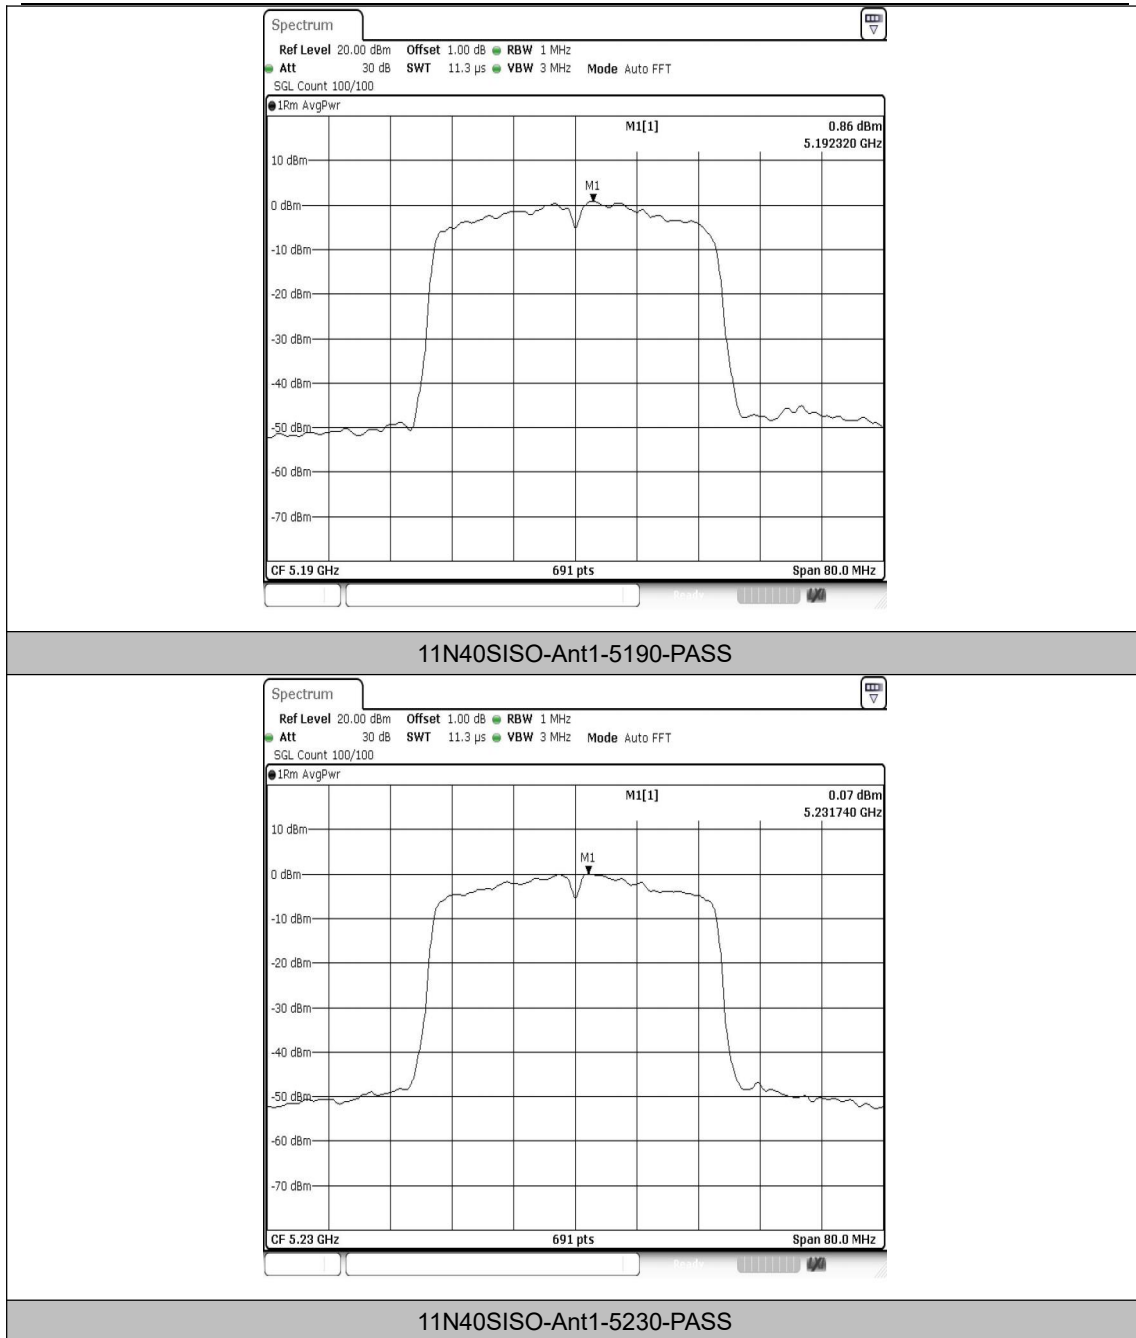

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

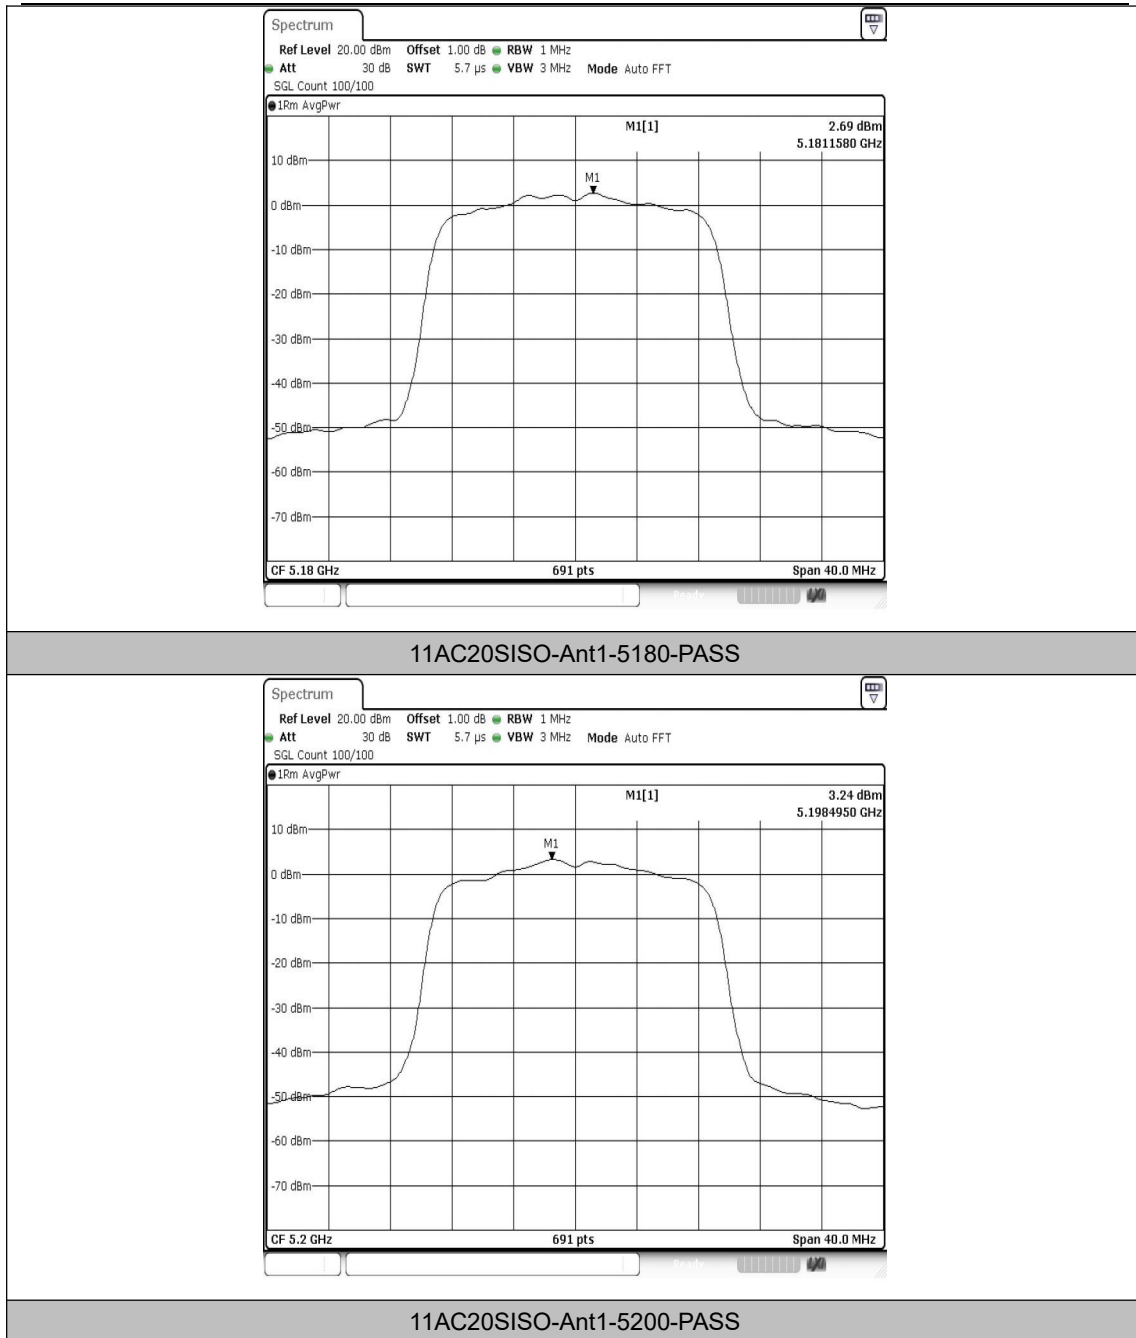

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

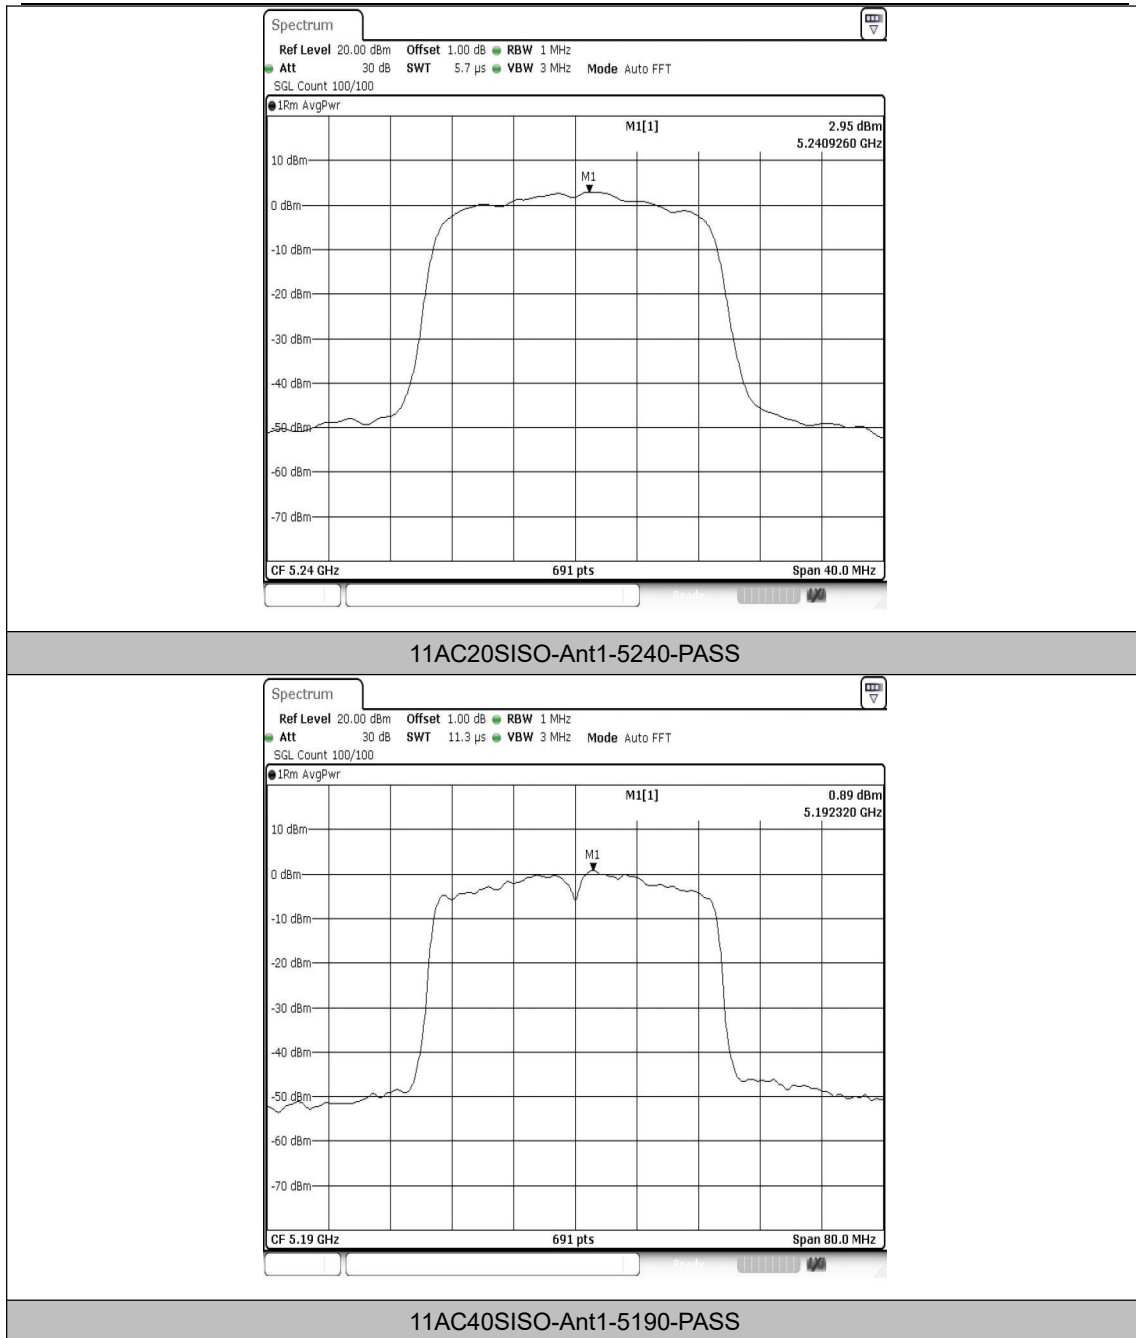

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

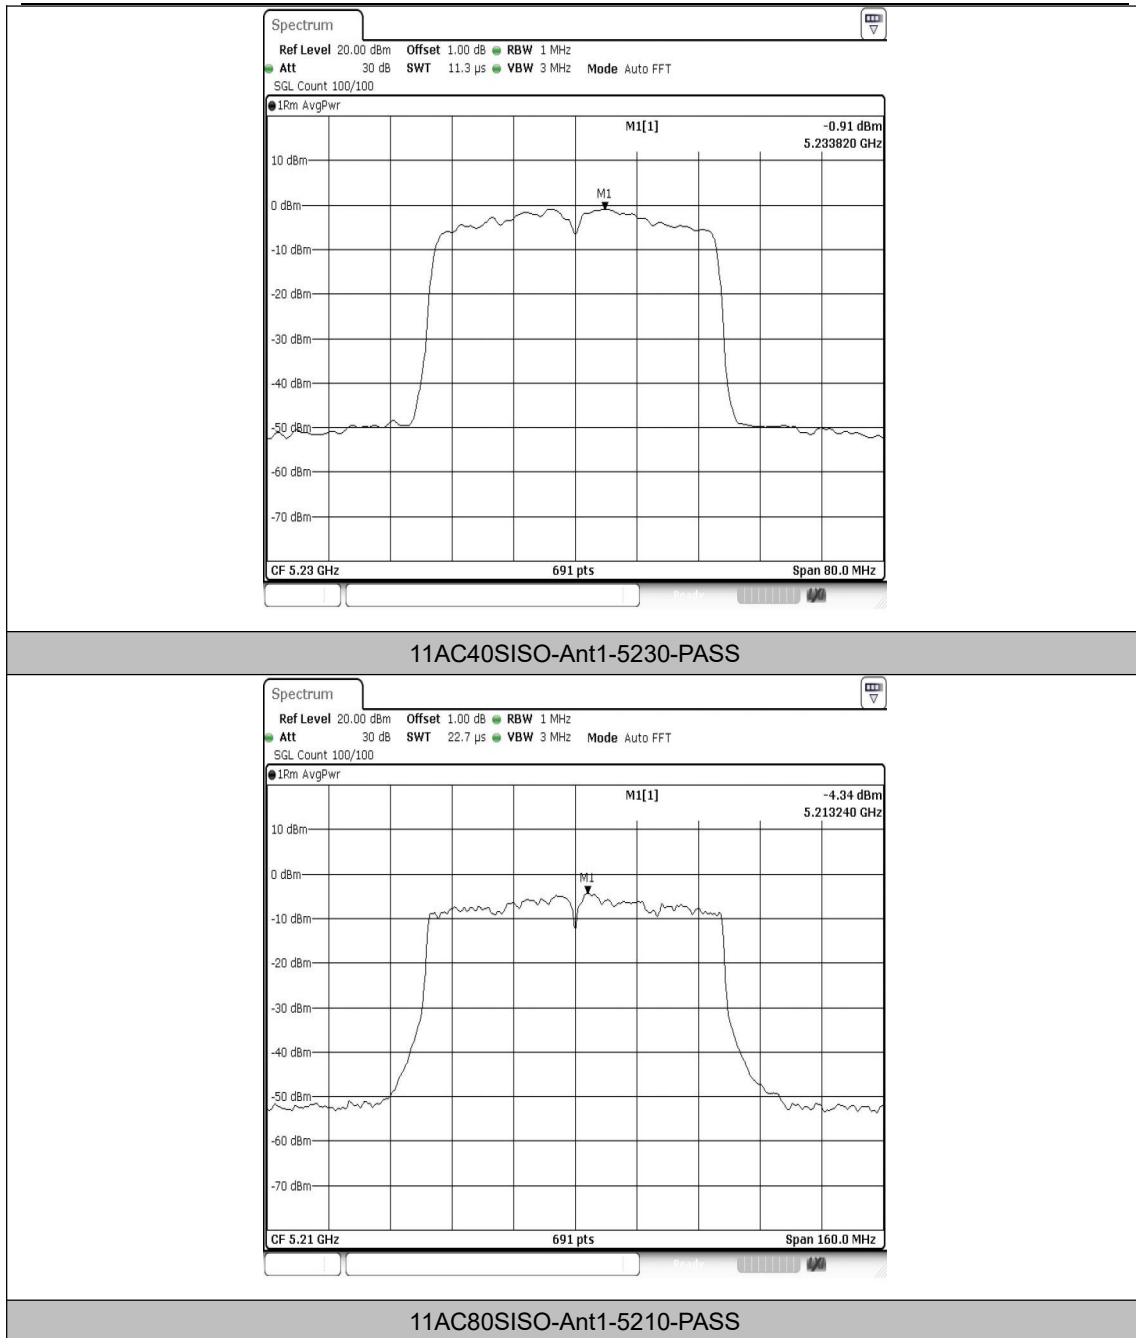


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com


Test Graphs B4

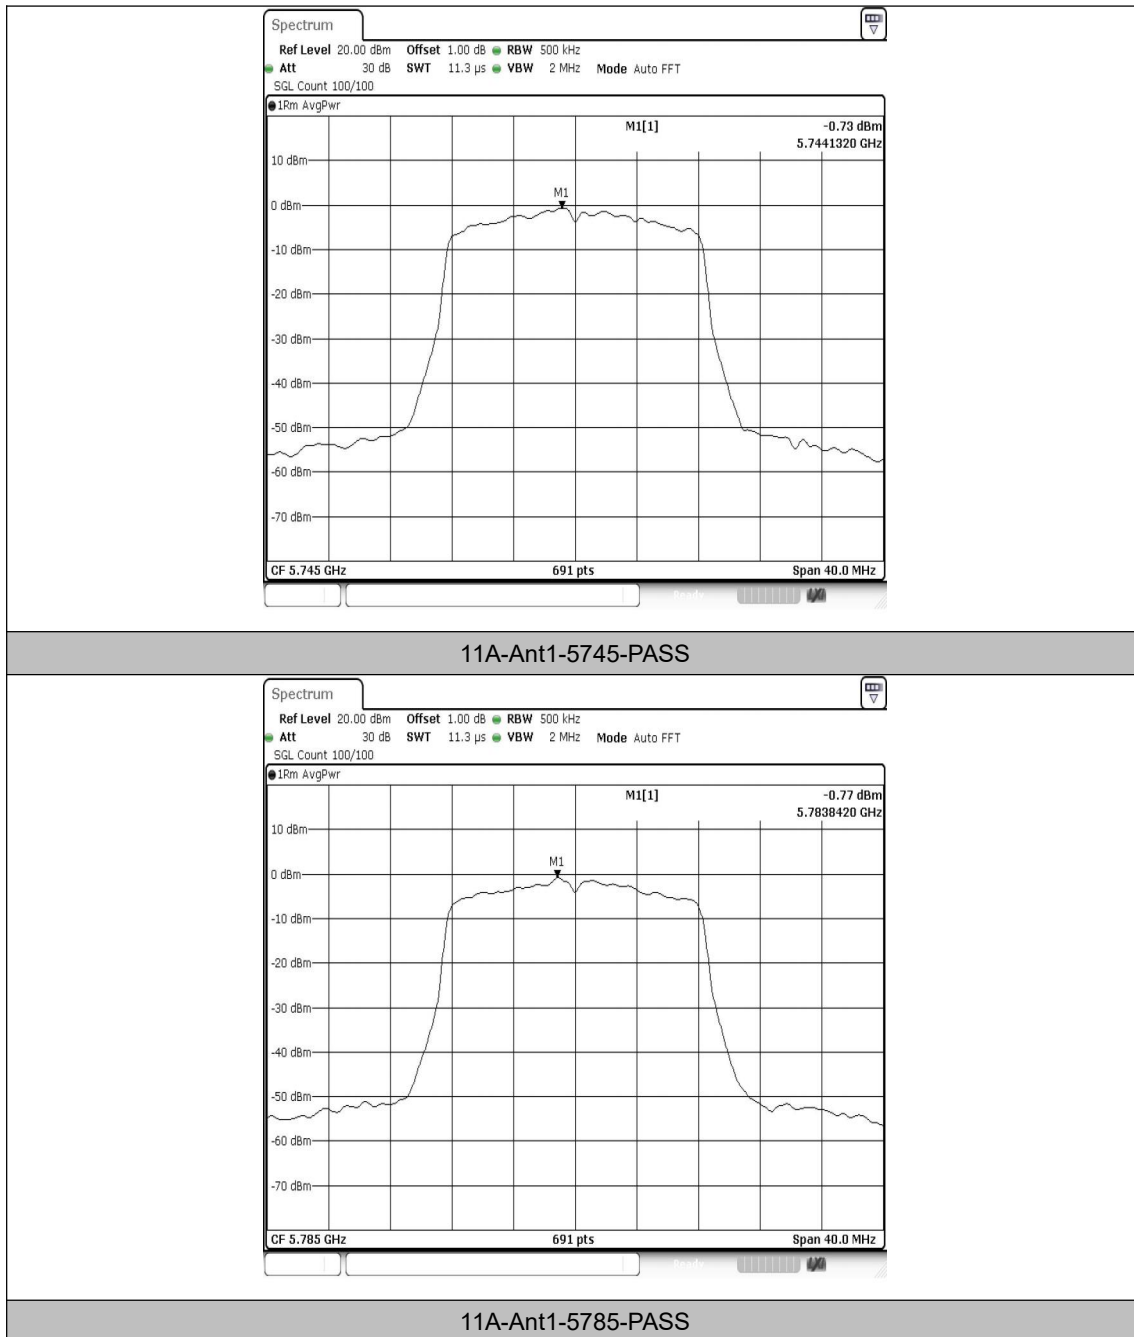


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

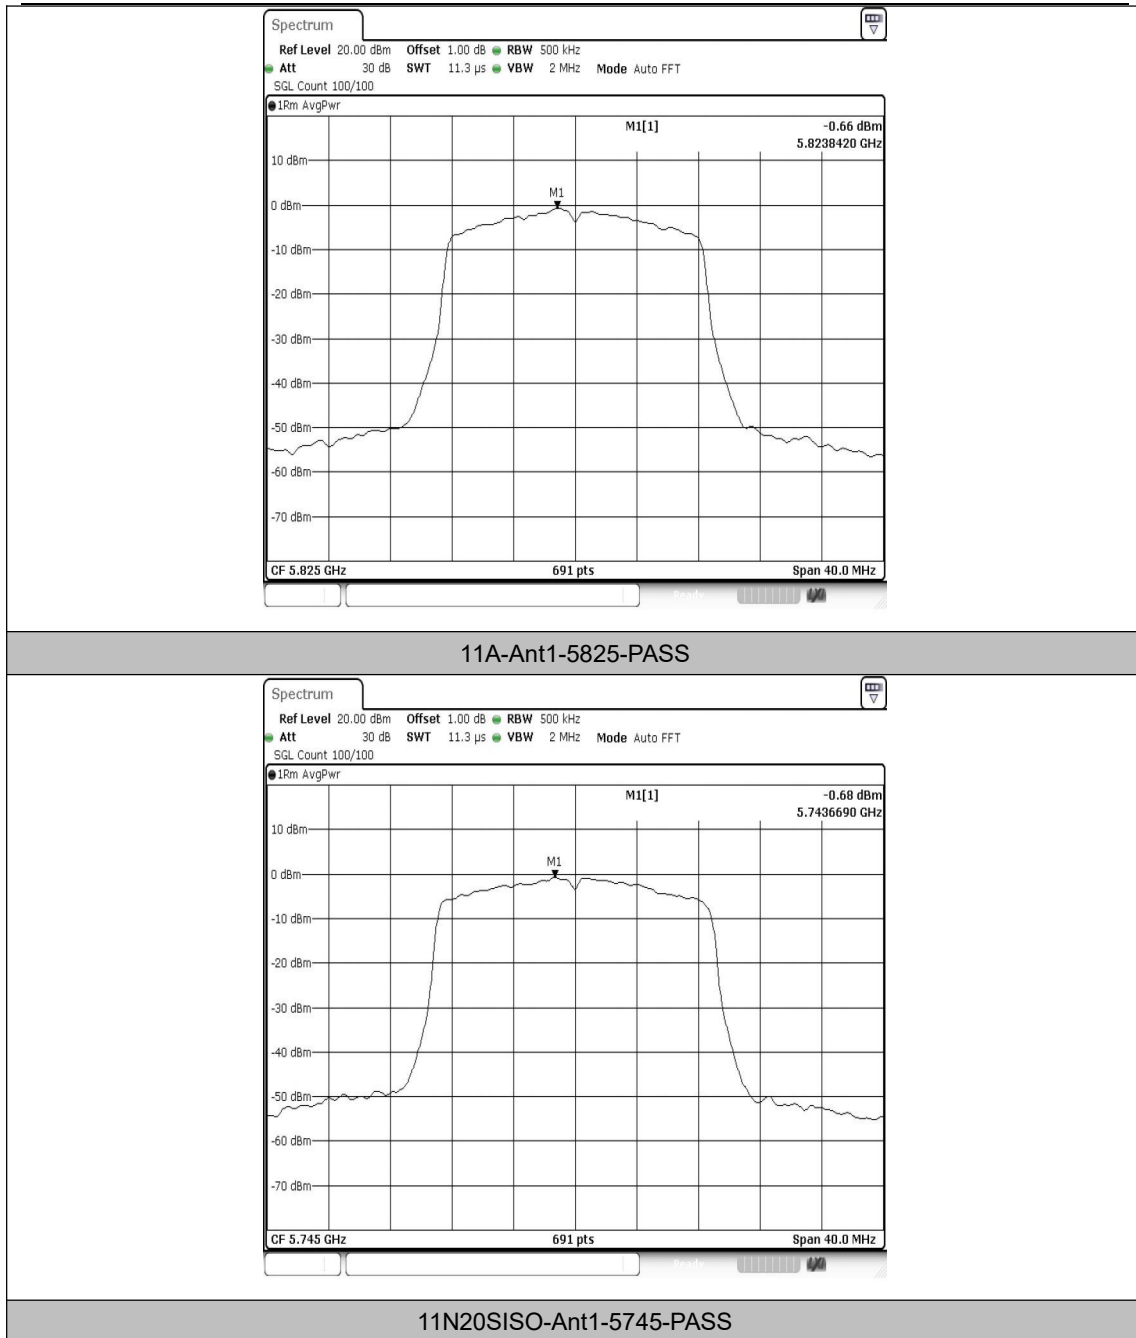


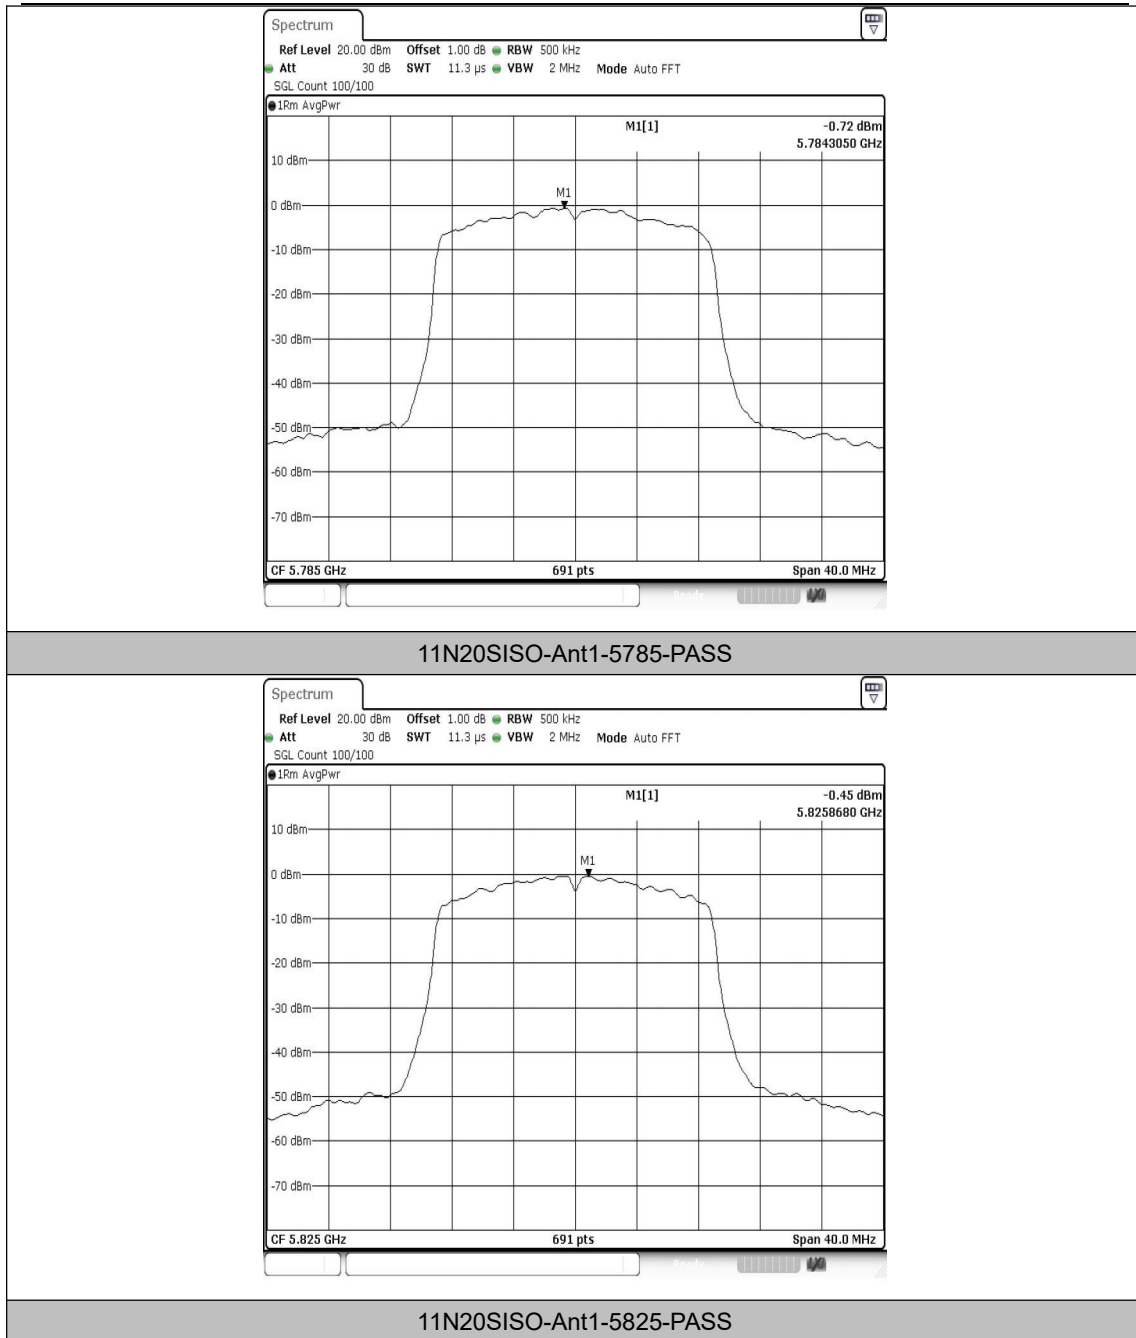

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

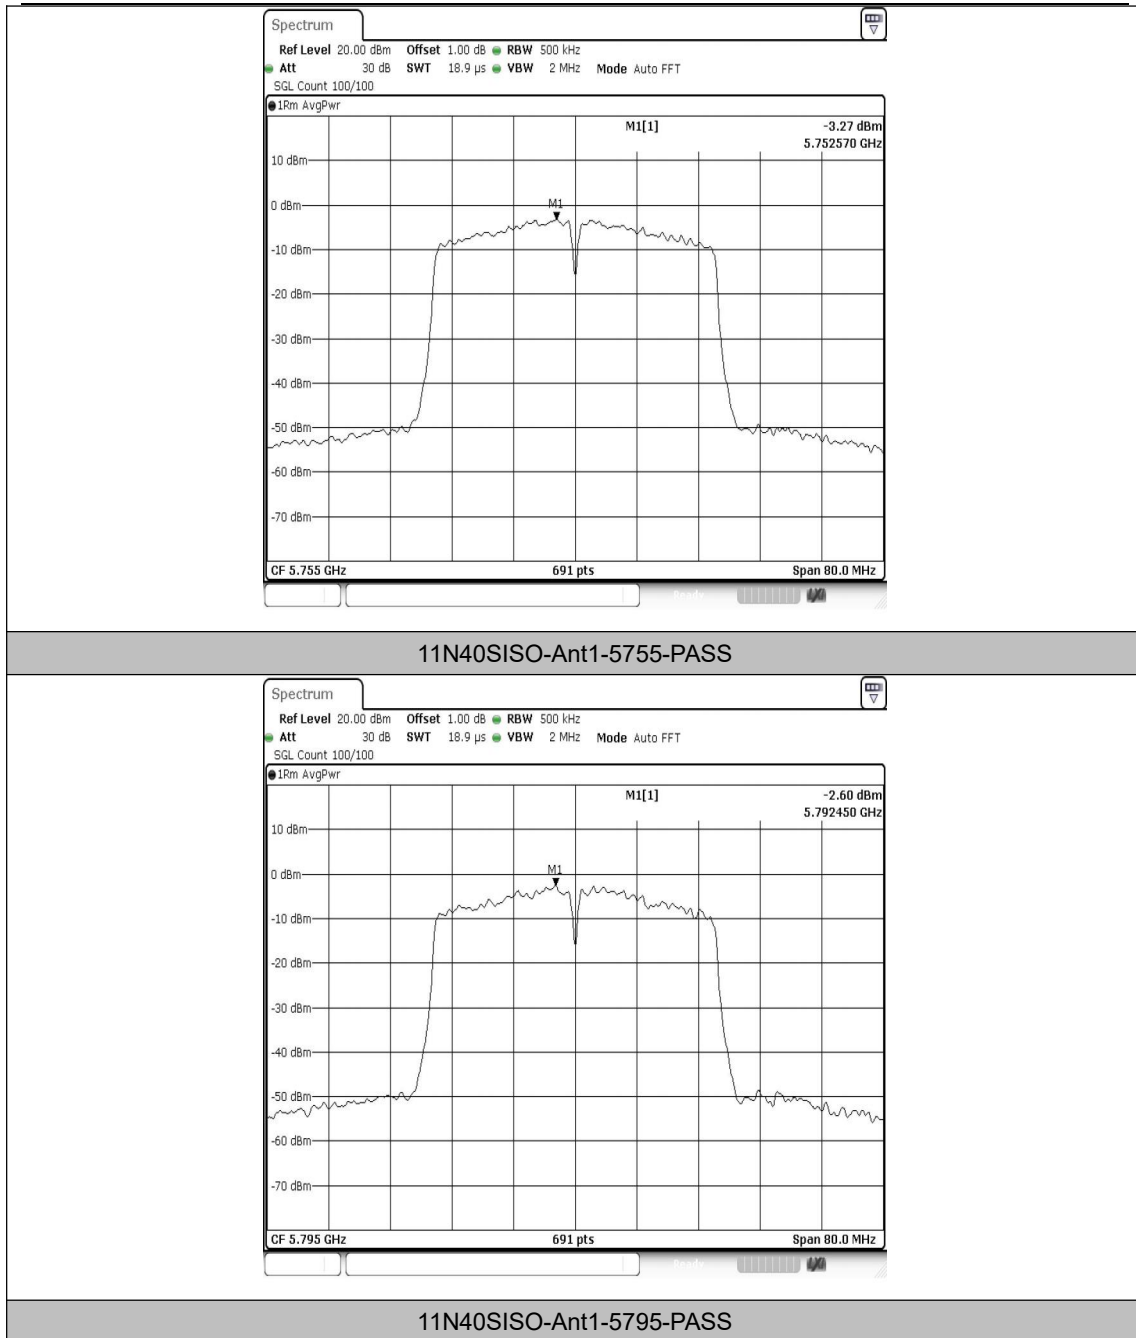

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

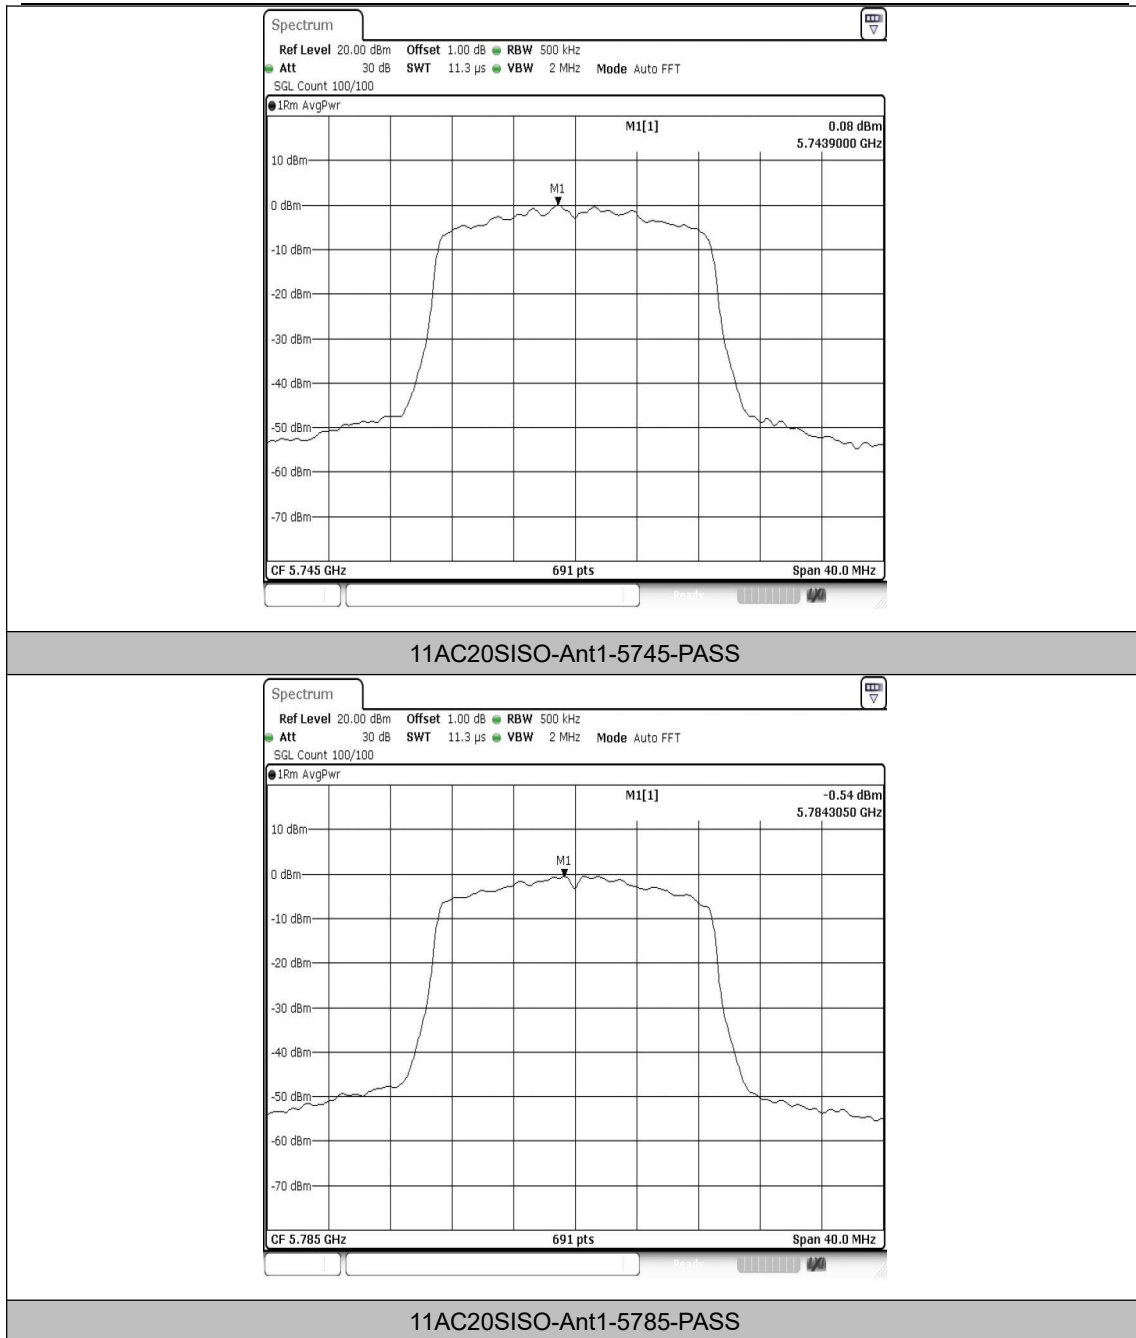

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


 Hotline
400-003-0500
www.anbotek.com

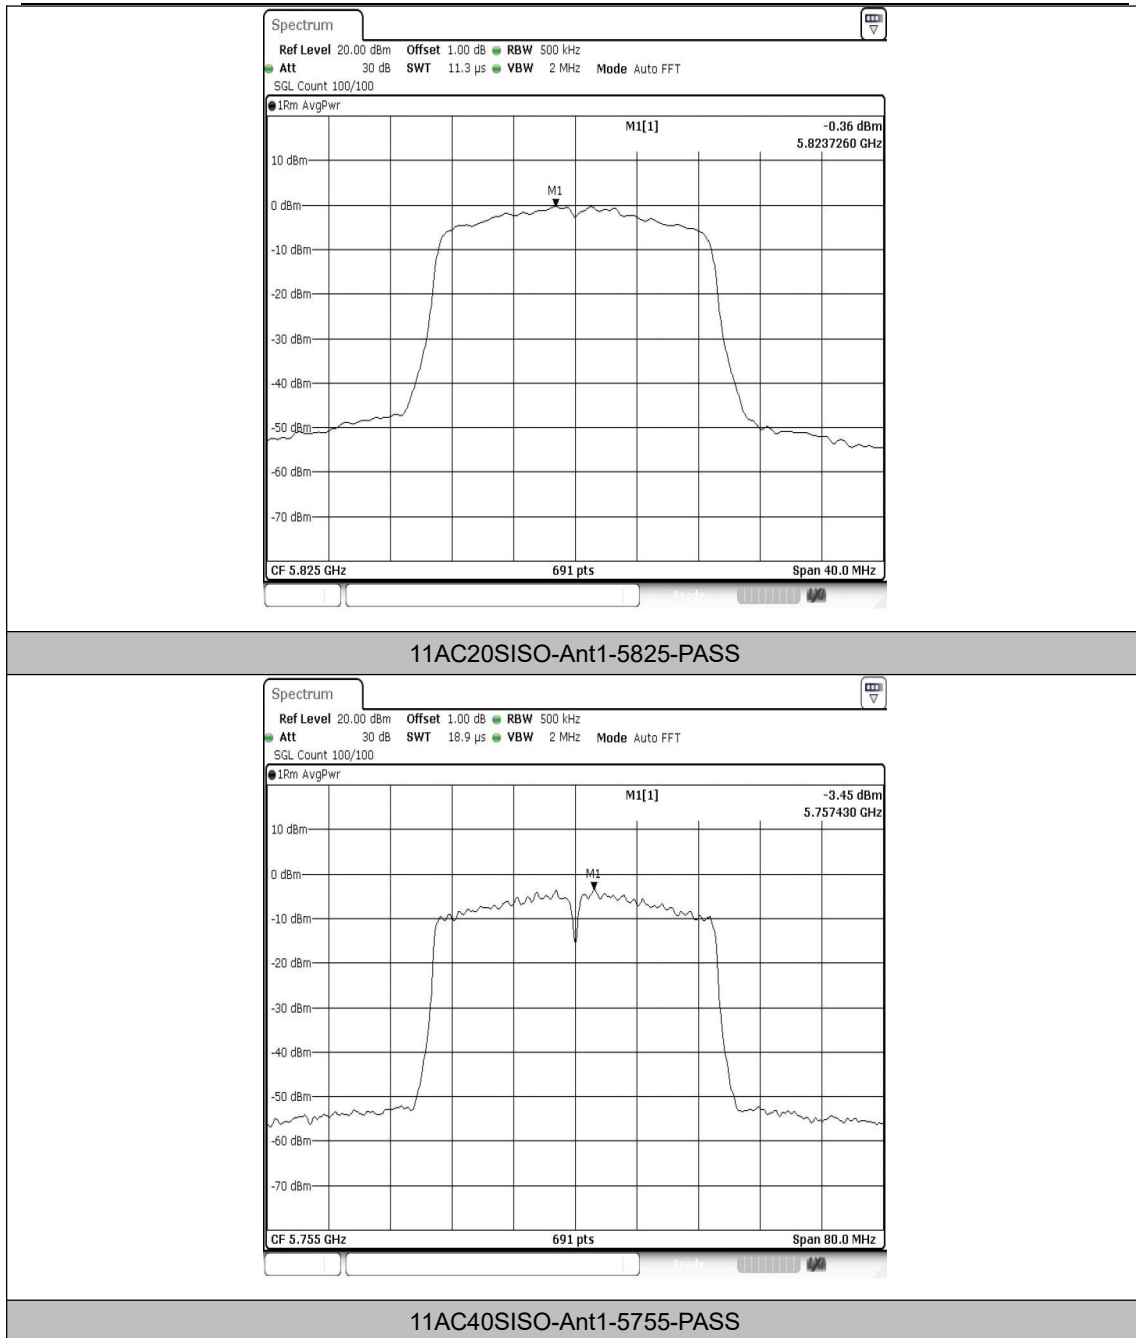

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

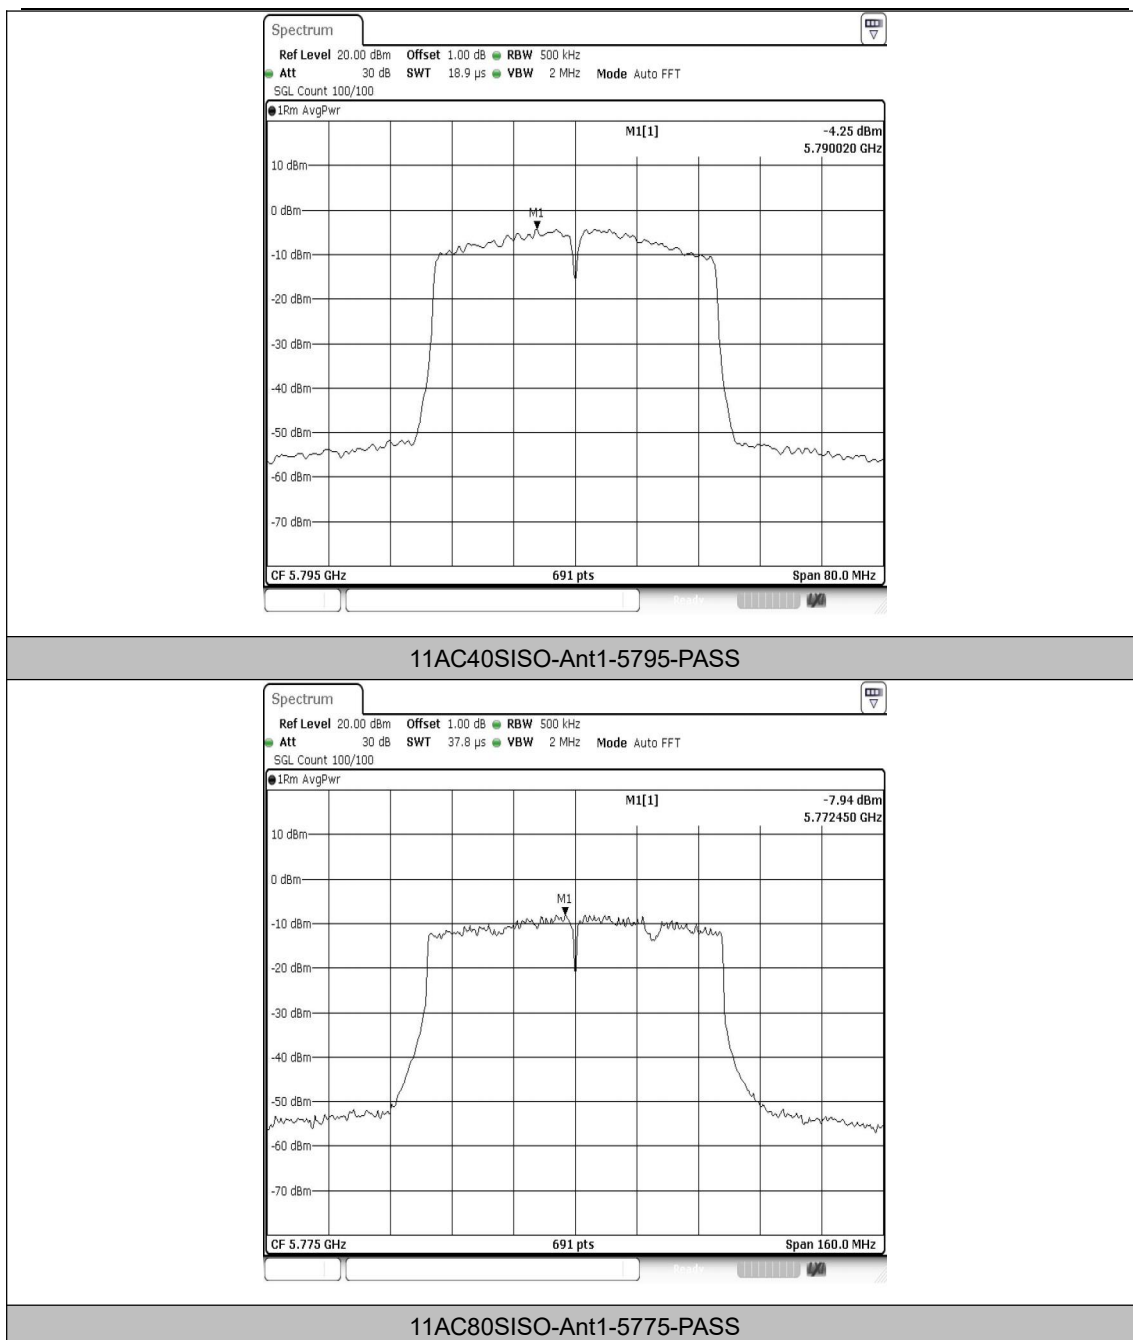

Appendix E: Band edge measurements

Test Result B1

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-36.34	≤-27	PASS
11A	Ant1	High	5240	-44.4	≤-27	PASS
11N20SISO	Ant1	Low	5180	-36.22	≤-27	PASS
11N20SISO	Ant1	High	5240	-42.7	≤-27	PASS
11N40SISO	Ant1	Low	5190	-35.9	≤-27	PASS
11N40SISO	Ant1	High	5230	-44.01	≤-27	PASS
11AC20SISO	Ant1	Low	5180	-36.71	≤-27	PASS
11AC20SISO	Ant1	High	5240	-43.83	≤-27	PASS
11AC40SISO	Ant1	Low	5190	-36.68	≤-27	PASS
11AC40SISO	Ant1	High	5230	-44.46	≤-27	PASS
11AC80SISO	Ant1	Low	5210	-34.28	≤-27	PASS
11AC80SISO	Ant1	High	5210	-43.45	≤-27	PASS

Note: The margin plus the antenna gain also meets the limit.



Test Result B4

Test Mode	Antenna	Ch. Name	Frequency[MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-46.33	≤15.98	PASS
11A	Ant1	Low	5745	5700~5720	-45.52	≤11.12	PASS
11A	Ant1	Low	5745	5650~5700	-48.14	≤-26.14	PASS
11A	Ant1	Low	5745	5760~5650	-47.6	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-44.96	≤15.65	PASS
11A	Ant1	High	5825	5855~5875	-45.77	≤10.51	PASS
11A	Ant1	High	5825	5875~5925	-46.74	≤-26.87	PASS
11A	Ant1	High	5825	5925~5935	-46.15	≤-27	PASS
11N20SI SO	Ant1	Low	5745	5720~5725	-40.78	≤15.98	PASS
11N20SI SO	Ant1	Low	5745	5700~5720	-43.94	≤11.31	PASS
11N20SI SO	Ant1	Low	5745	5650~5700	-47.65	≤-26.88	PASS
11N20SI SO	Ant1	Low	5745	5760~5650	-46.26	≤-27	PASS
11N20SI SO	Ant1	High	5825	5850~5855	-45.71	≤15.65	PASS
11N20SI SO	Ant1	High	5825	5855~5875	-45.55	≤10.51	PASS
11N20SI SO	Ant1	High	5825	5875~5925	-44.96	≤-26.58	PASS
11N20SI SO	Ant1	High	5825	5925~5935	-44.76	≤-27	PASS
11N40SI SO	Ant1	Low	5755	5720~5725	-38.29	≤15.90	PASS
11N40SI SO	Ant1	Low	5755	5700~5720	-36.9	≤15.53	PASS
11N40SI SO	Ant1	Low	5755	5650~5700	-45.07	≤-26.94	PASS
11N40SI SO	Ant1	Low	5755	5780~5650	-45.25	≤-27	PASS
11N40SI SO	Ant1	High	5795	5850~5855	-46.51	≤15.85	PASS
11N40SI SO	Ant1	High	5795	5855~5875	-45.78	≤10.14	PASS
11N40SI SO	Ant1	High	5795	5875~5925	-45.54	≤-26.79	PASS
11N40SI	Ant1	High	5795	5925~5935	-44.54	≤-27	PASS

Shenzhen Anbotech Compliance Laboratory Limited



SO							
11AC20S ISO	Ant1	Low	5745	5720~5725	-45.56	≤15.98	PASS
11AC20S ISO	Ant1	Low	5745	5700~5720	-44.79	≤10.28	PASS
11AC20S ISO	Ant1	Low	5745	5650~5700	-47.49	≤-26.88	PASS
11AC20S ISO	Ant1	Low	5745	5760~5650	-47.38	≤-27	PASS
11AC20S ISO	Ant1	High	5825	5850~5855	-46.98	≤15.65	PASS
11AC20S ISO	Ant1	High	5825	5855~5875	-45.3	≤11.06	PASS
11AC20S ISO	Ant1	High	5825	5875~5925	-46.4	≤-26.29	PASS
11AC20S ISO	Ant1	High	5825	5925~5935	-45.51	≤-27	PASS
11AC40S ISO	Ant1	Low	5755	5720~5725	-42.97	≤15.90	PASS
11AC40S ISO	Ant1	Low	5755	5700~5720	-44.94	≤10.05	PASS
11AC40S ISO	Ant1	Low	5755	5650~5700	-46.59	≤-26.50	PASS
11AC40S ISO	Ant1	Low	5755	5780~5650	-46.48	≤-27	PASS
11AC40S ISO	Ant1	High	5795	5850~5855	-46.57	≤15.85	PASS
11AC40S ISO	Ant1	High	5795	5855~5875	-44.05	≤10.47	PASS
11AC40S ISO	Ant1	High	5795	5875~5925	-48.02	≤-26.97	PASS
11AC40S ISO	Ant1	High	5795	5925~5935	-46.06	≤-27	PASS
11AC80S ISO	Ant1	Low	5775	5720~5725	-36.86	≤15.67	PASS
11AC80S ISO	Ant1	Low	5775	5700~5720	-36.8	≤14.54	PASS
11AC80S ISO	Ant1	Low	5775	5650~5700	-46.08	≤-26.88	PASS
11AC80S ISO	Ant1	Low	5775	5800~5650	-44.85	≤-27	PASS
11AC80S ISO	Ant1	High	5775	5850~5855	-45.32	≤15.98	PASS

Shenzhen Anbotech Compliance Laboratory Limited





11AC80S ISO	Ant1	High	5775	5855~5875	-43.99	≤10.17	PASS
11AC80S ISO	Ant1	High	5775	5875~5925	-46.66	≤-26.27	PASS
11AC80S ISO	Ant1	High	5775	5925~5935	-45.07	≤-27	PASS


Note: The margin plus the antenna gain also meets the limit.





Test Graphs B1

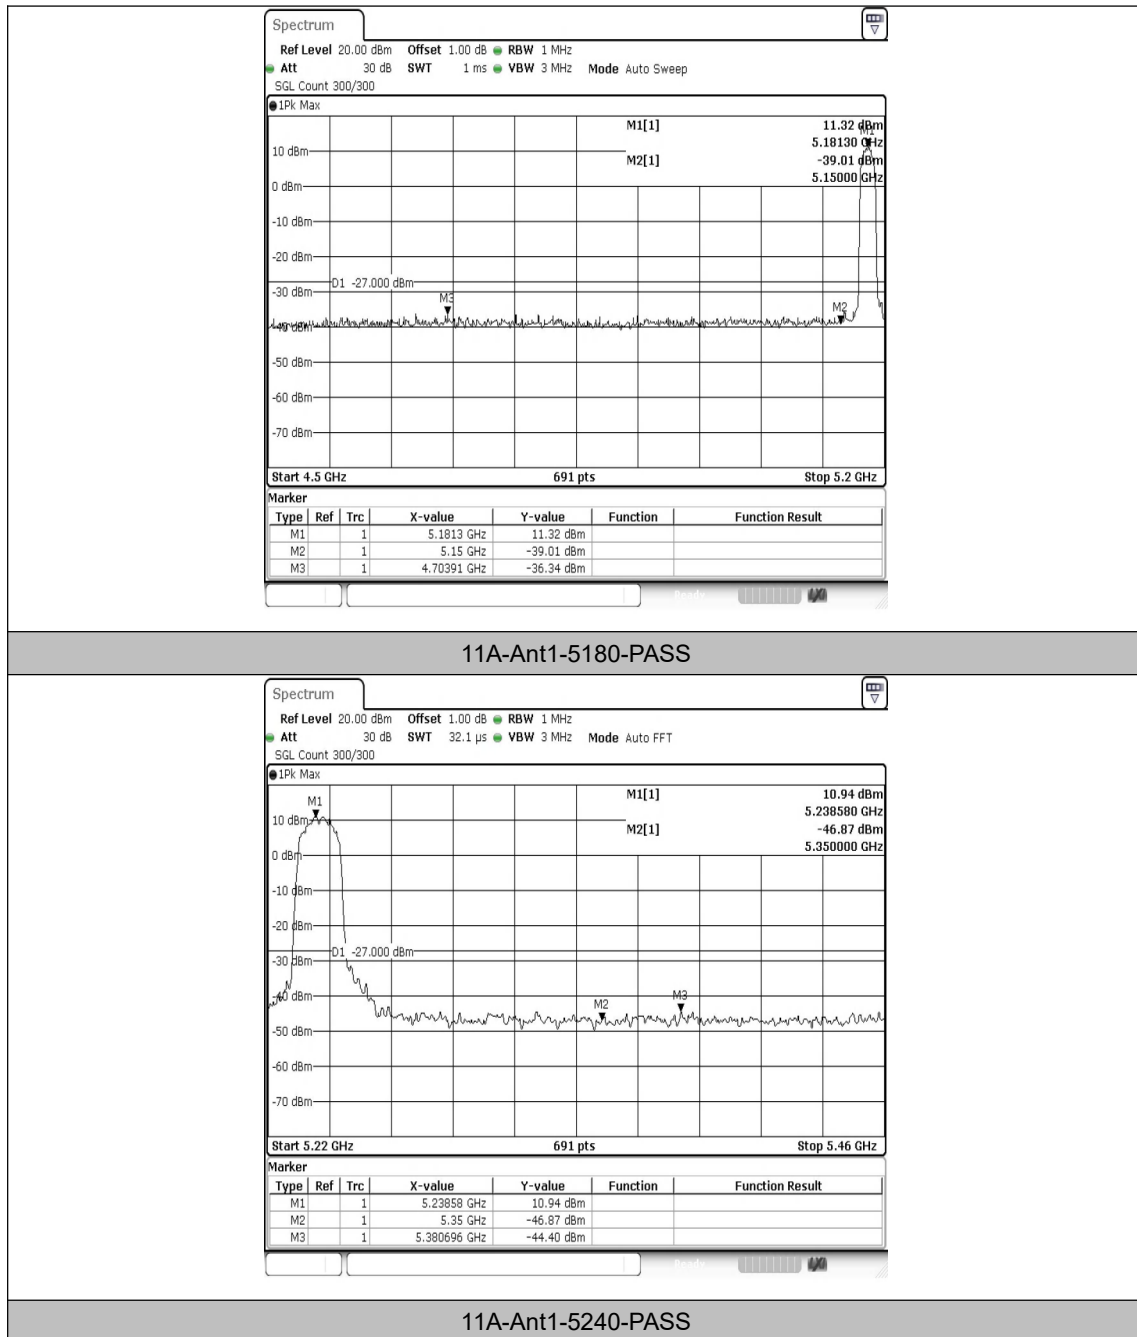

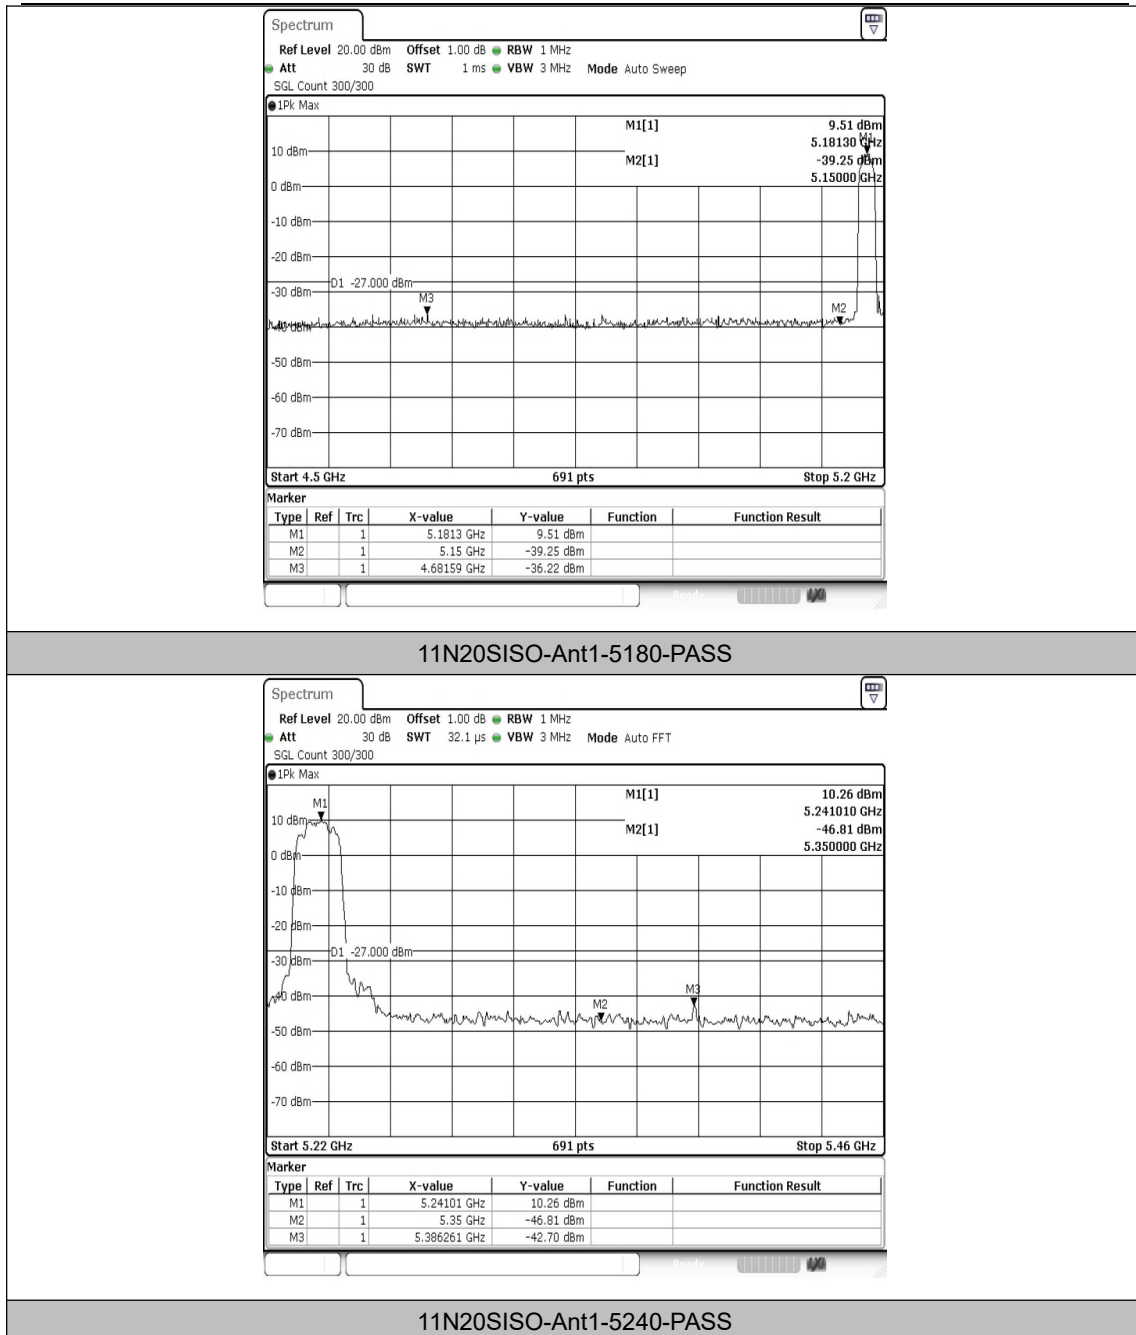

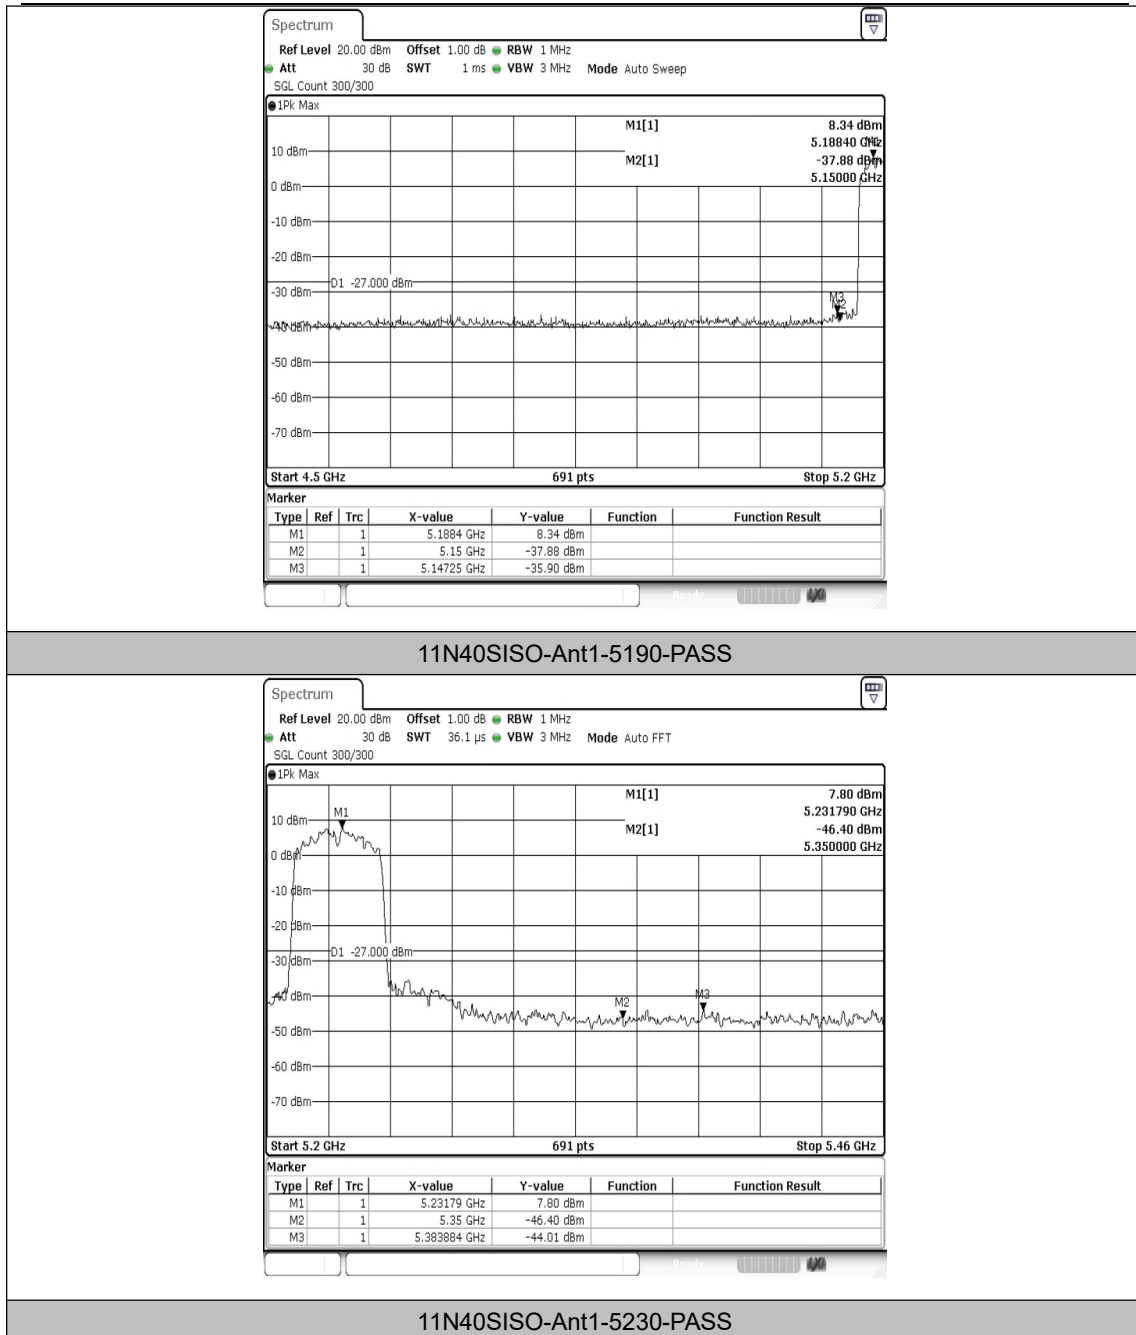

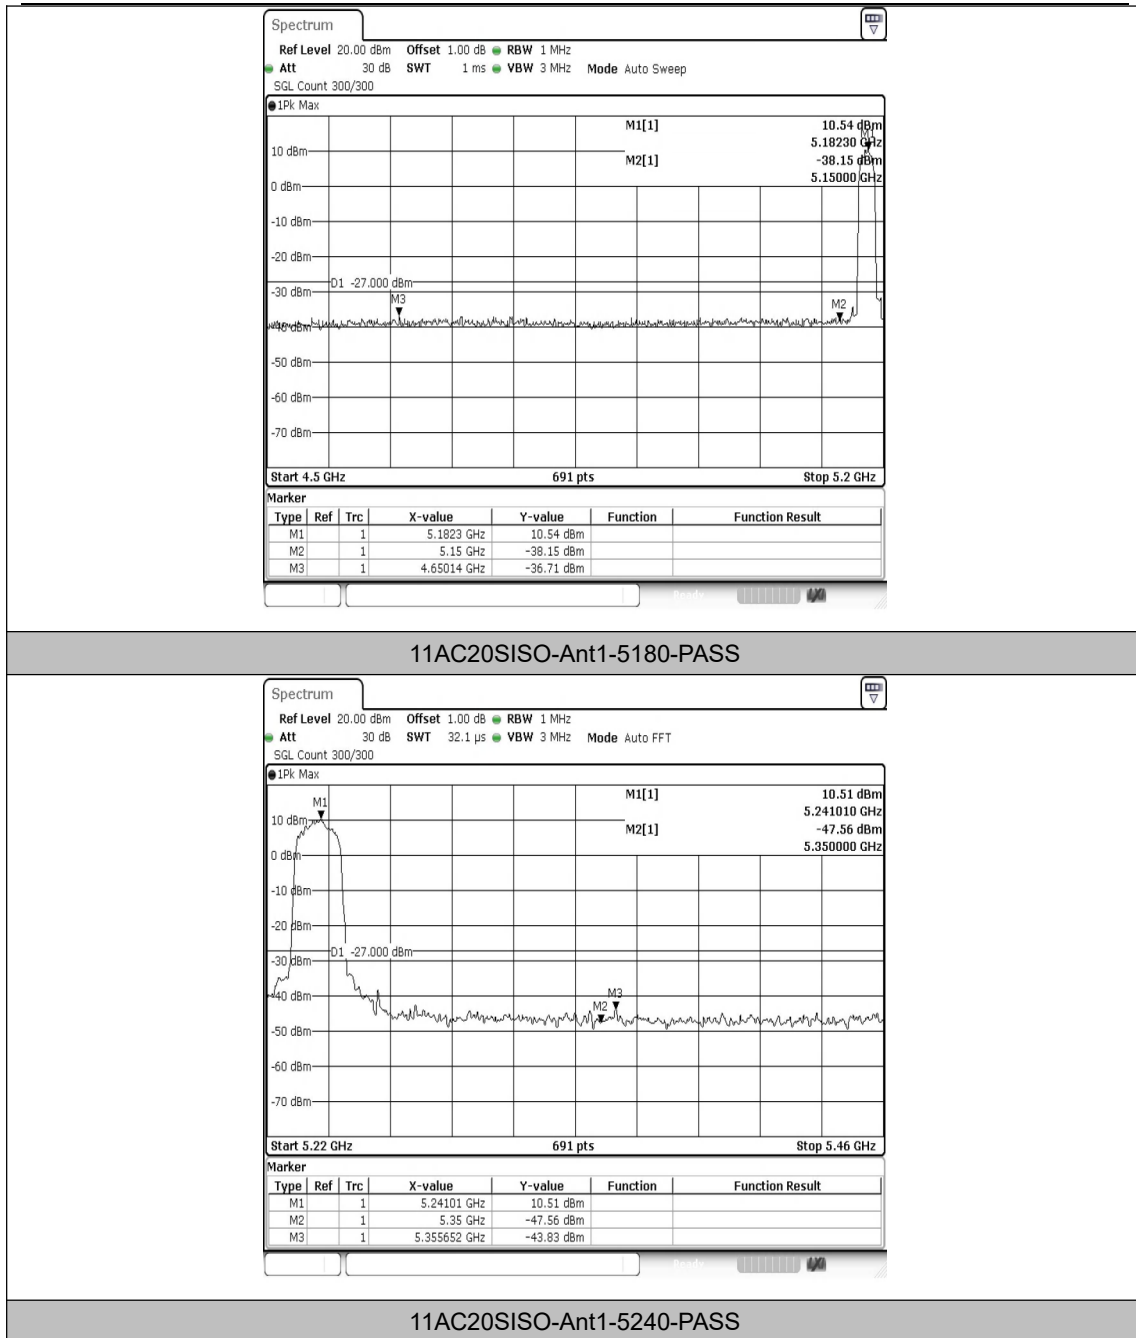


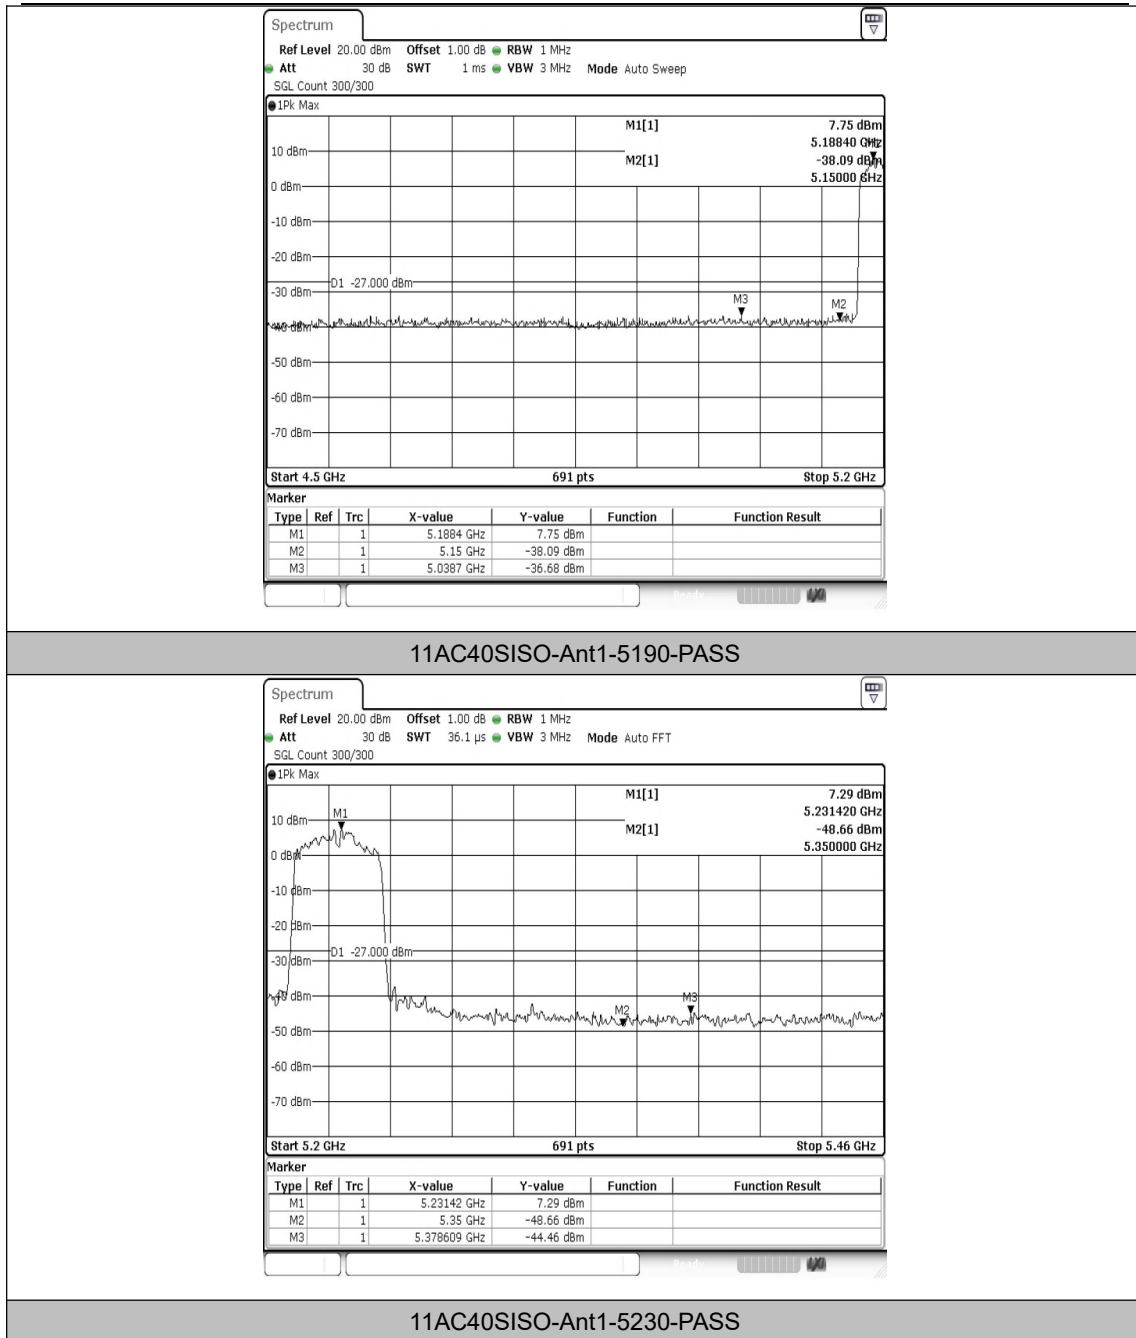


Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

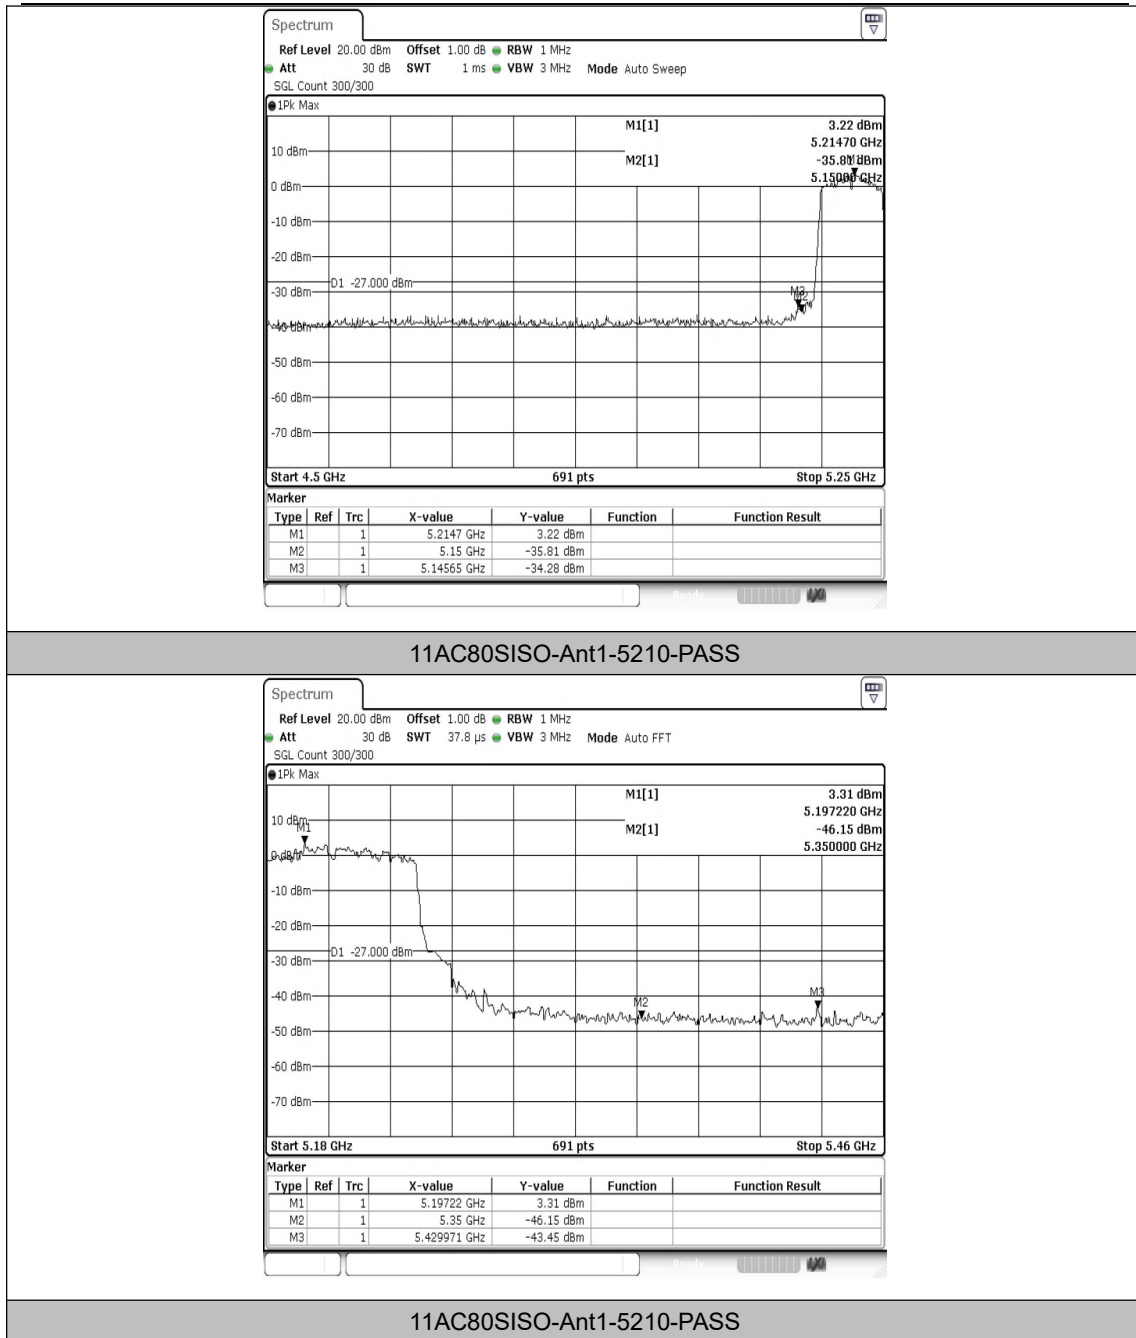


Test Graphs B4

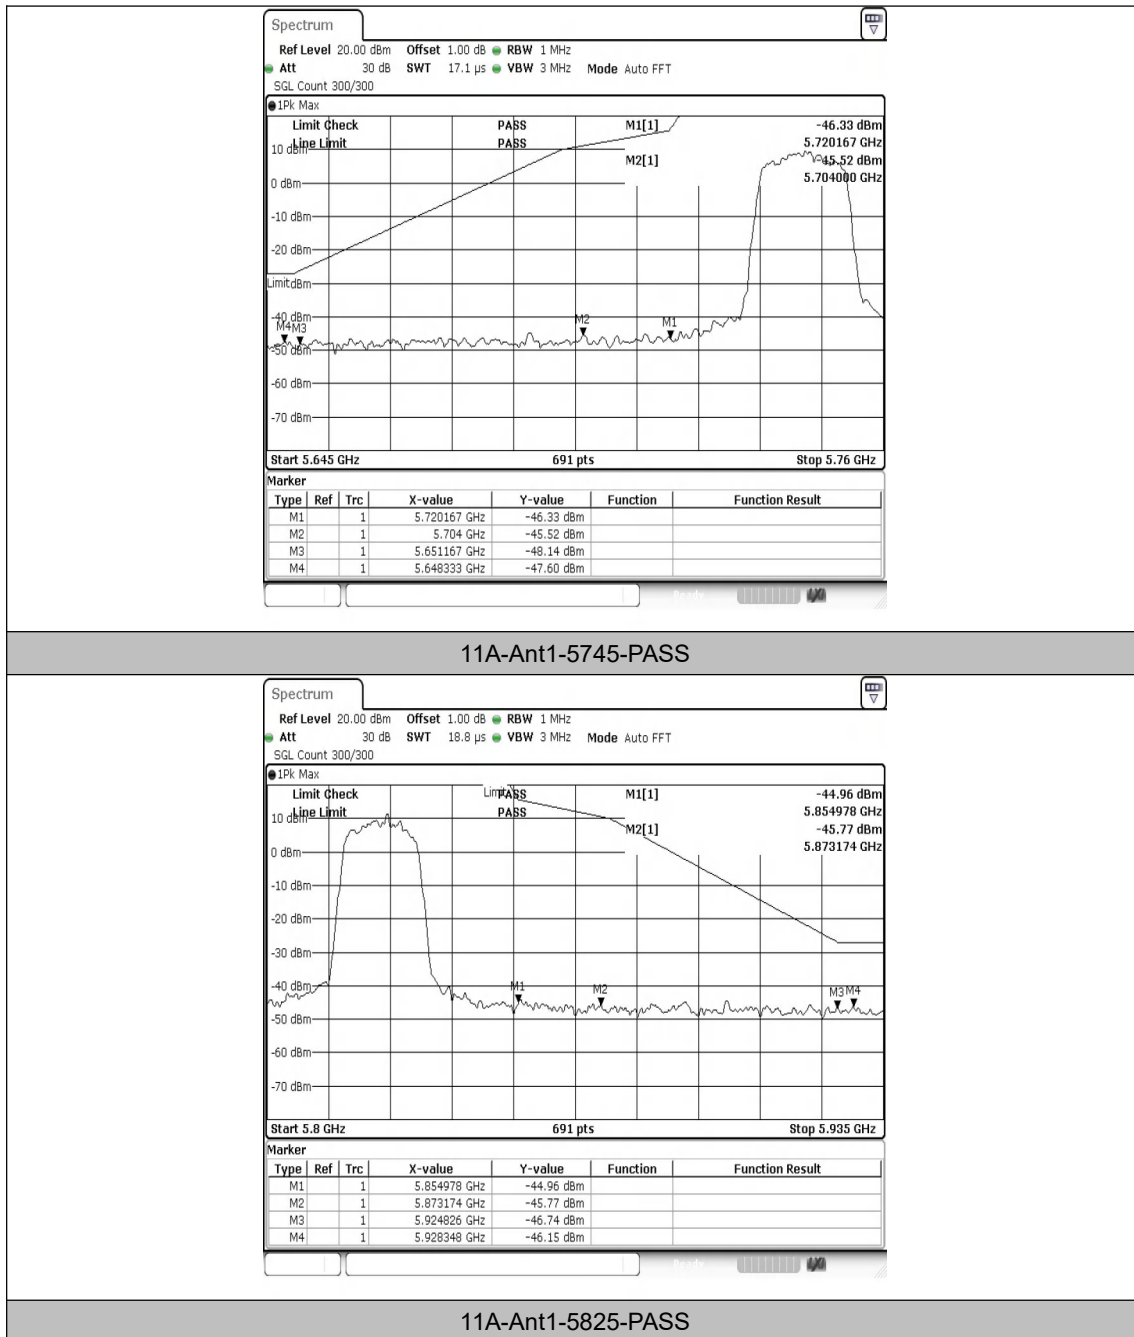

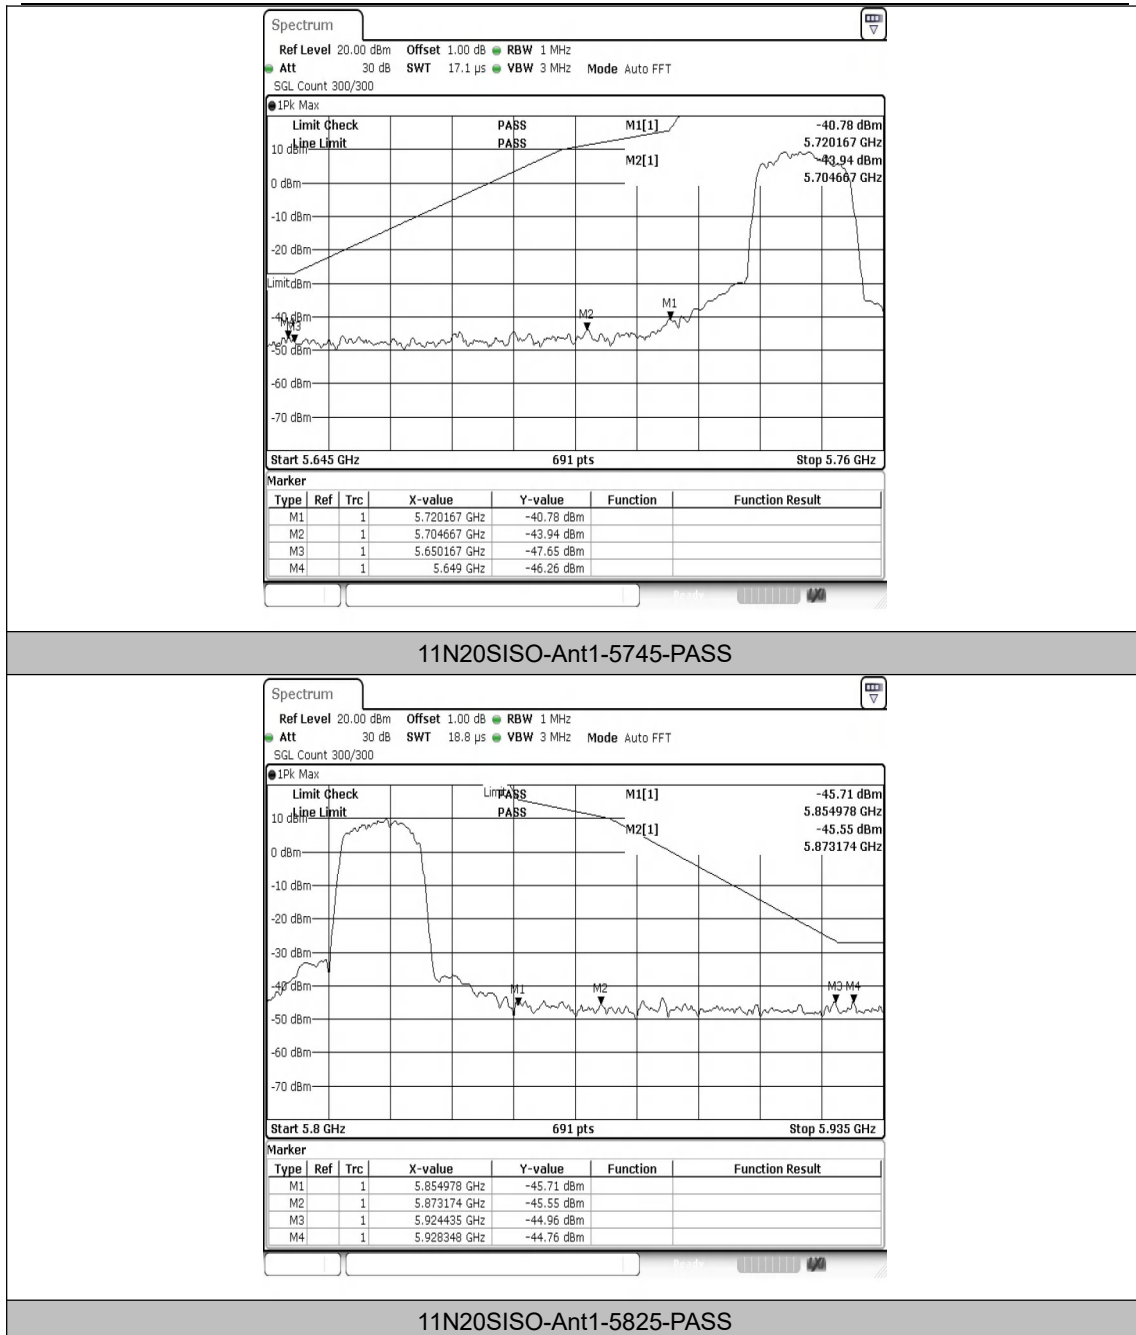

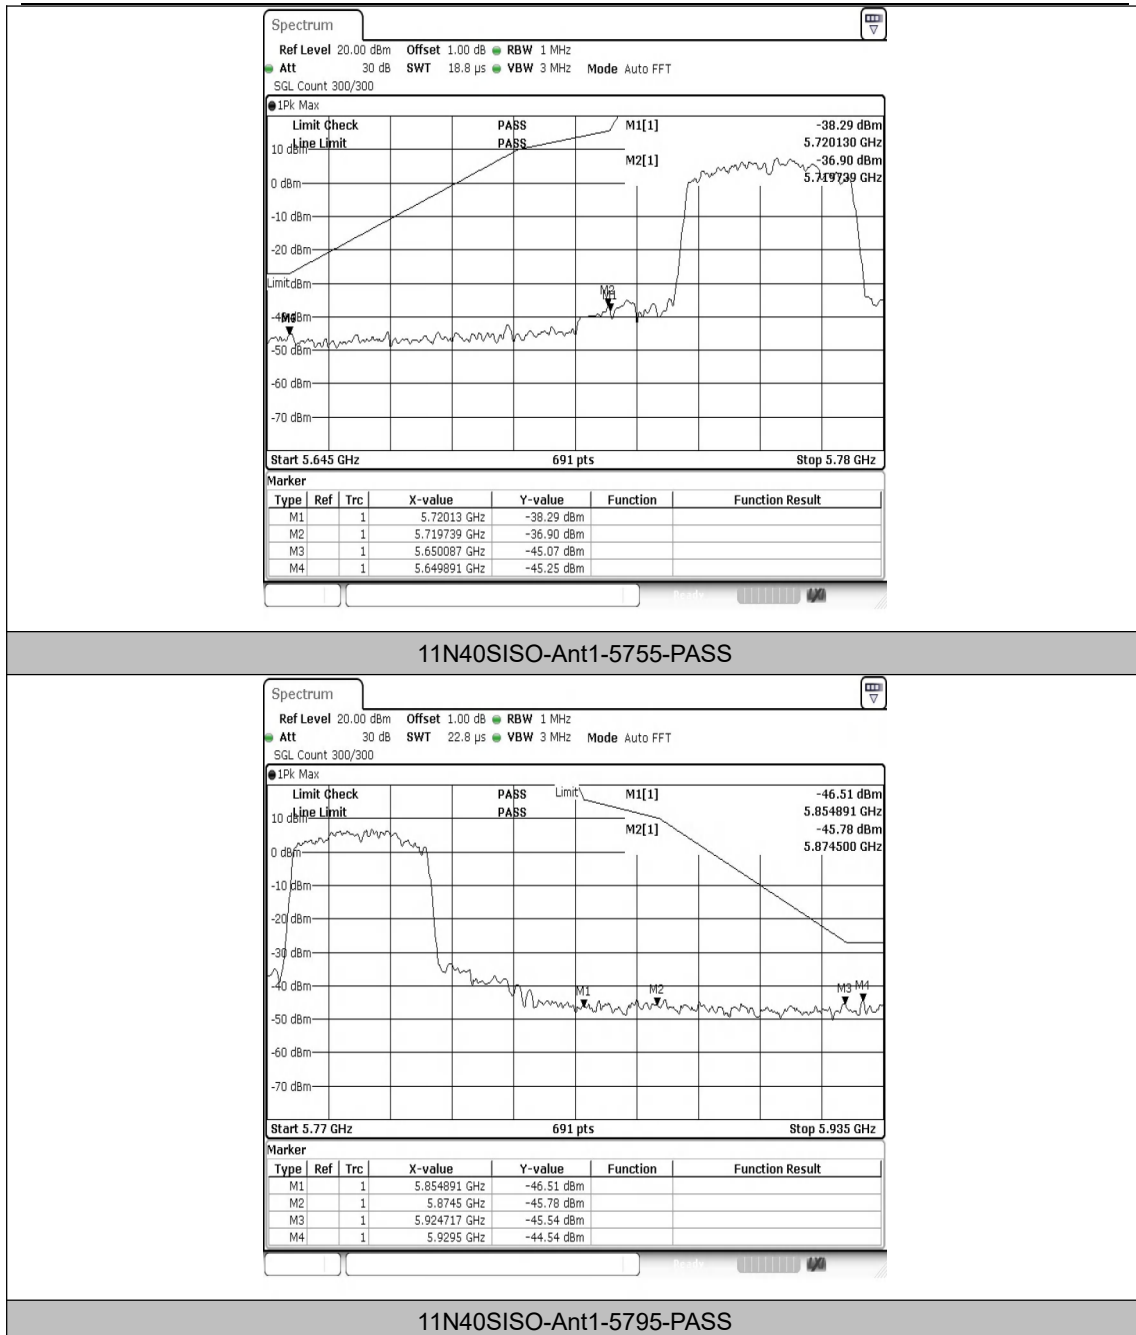


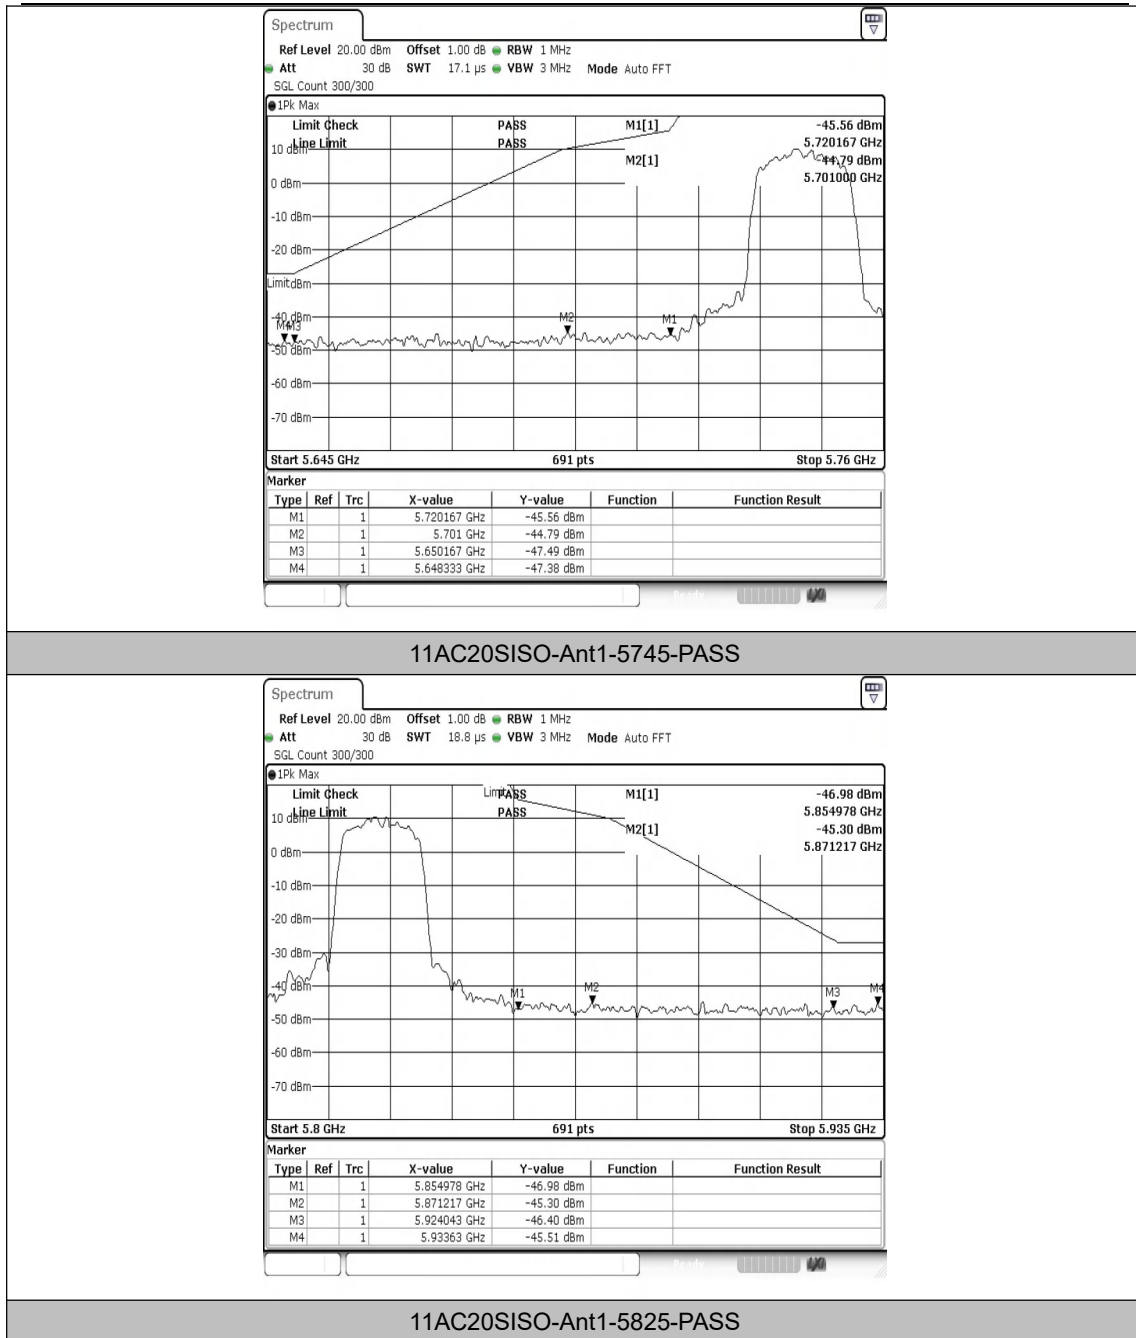


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline 400-003-0500
www.anbotech.com

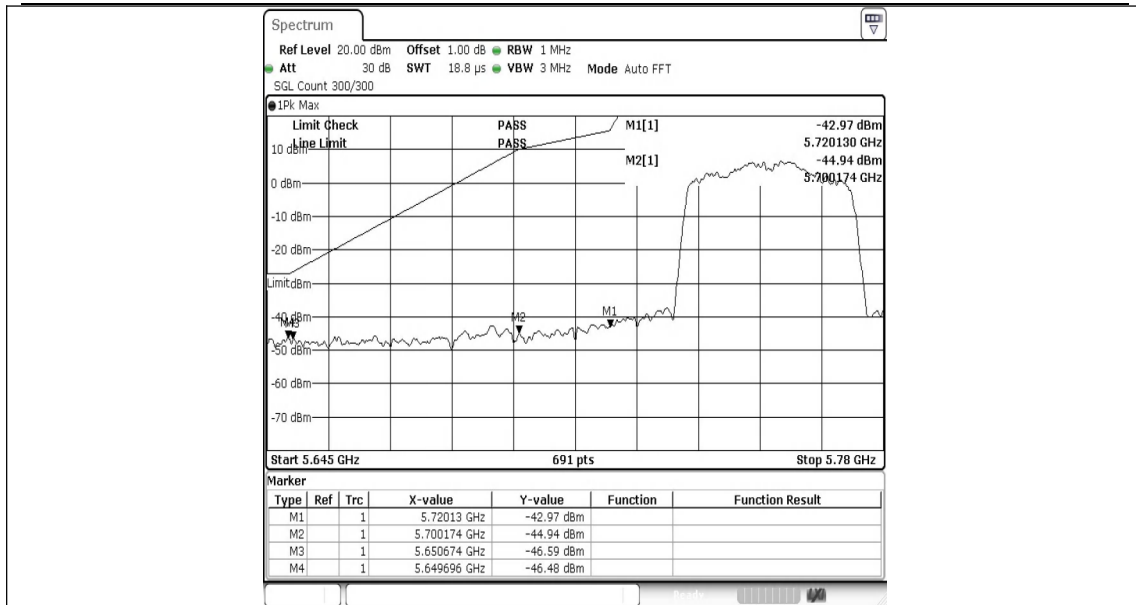

11AC40SISO-Ant1-5755-PASS

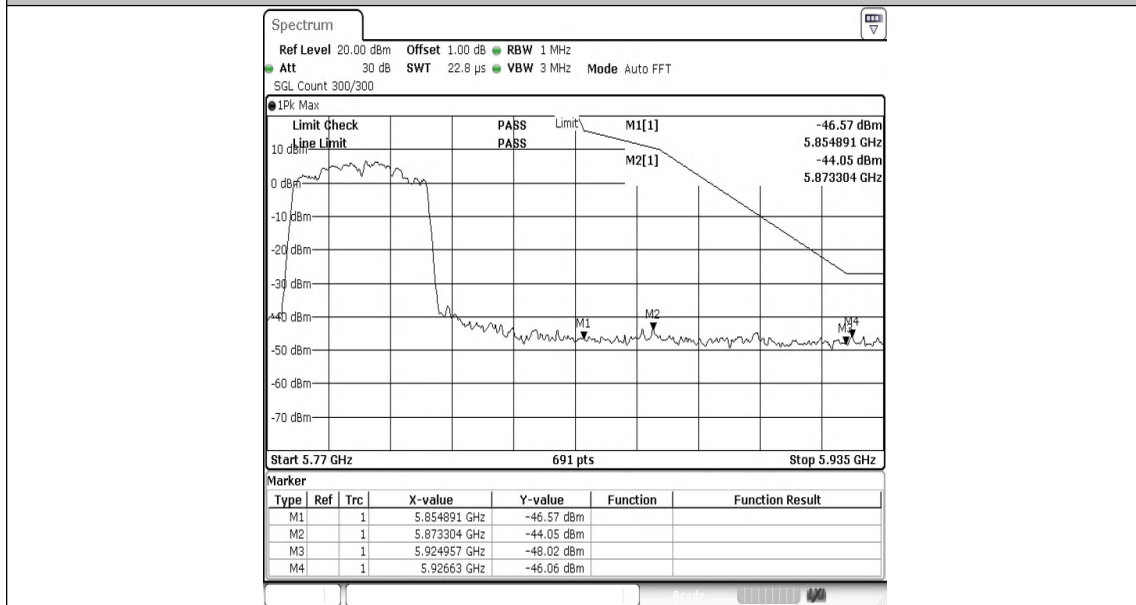

11AC40SISO-Ant1-5795-PASS

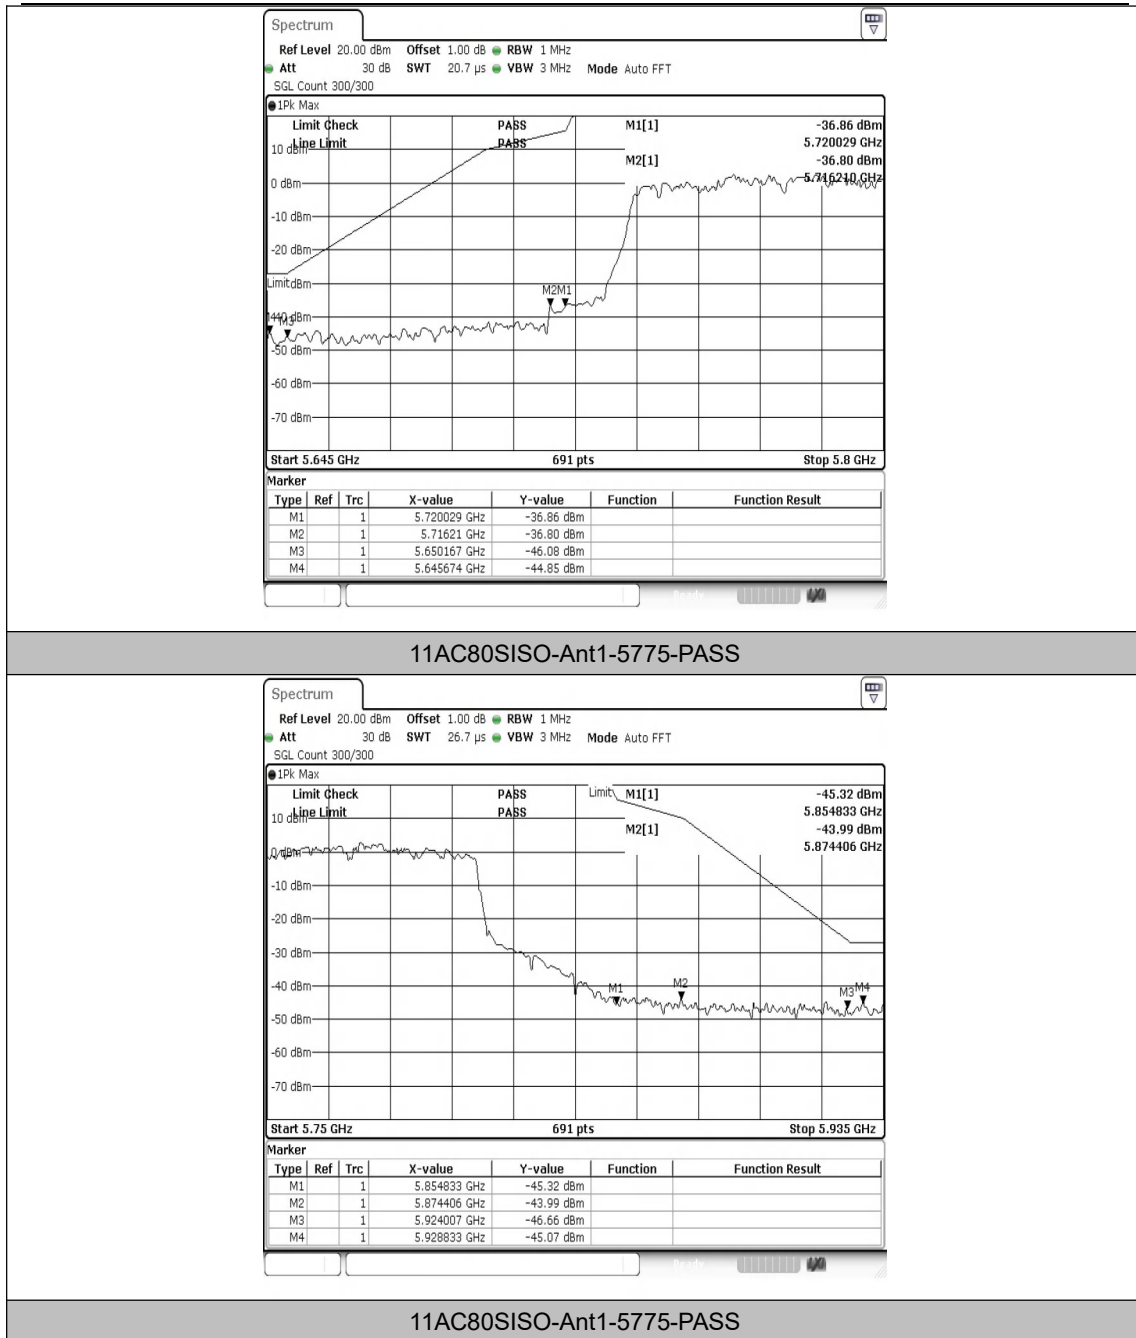

---End---