


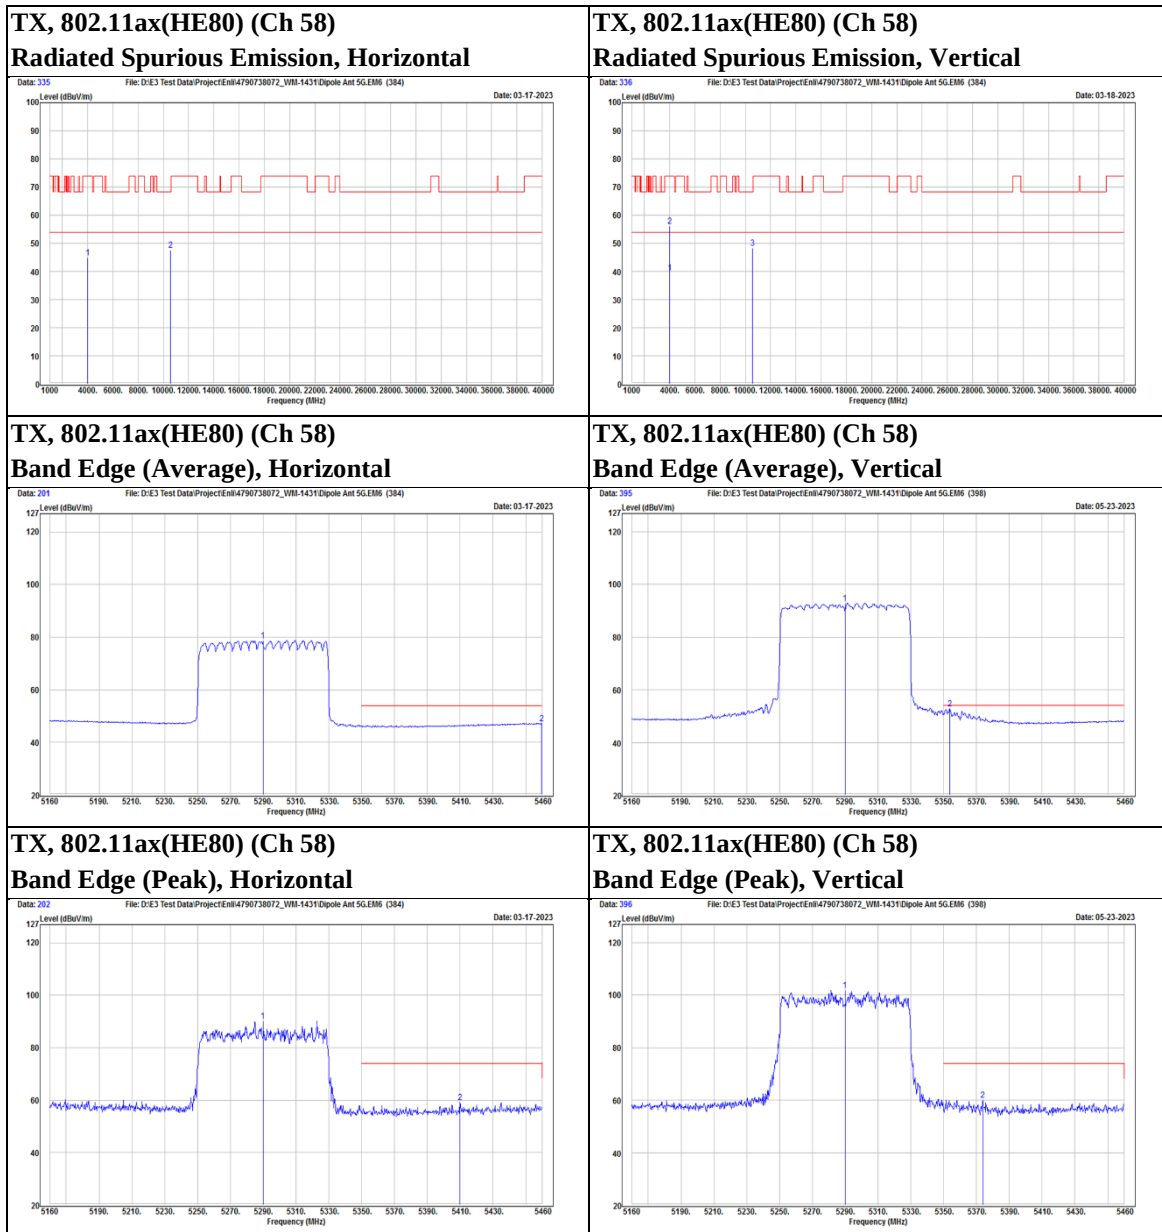

Mode	802.11ax(HE80)	Channel	106
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	3992	46.34	0.05	46.39	74	-27.61	PK
		5439.2	39.68	19.53	59.21	74	-14.79	PK
		5459.15	27.79	19.64	47.43	54	-6.57	AVG
		5462.65	39.36	19.64	59	68.2	-9.2	PK
	@	5530	68.05	19.61	87.66	N/A	N/A	PK
	@	5530	58.22	19.61	77.83	N/A	N/A	AVG
	*	11060	30.31	18.15	48.46	74	-25.54	PK
Vertical		3992	56.84	0.05	56.89	74	-17.11	PK
		3992	40.27	0.05	40.32	54	-13.68	AVG
		5452.5	44.7	19.63	64.33	74	-9.67	PK
		5459.85	33.91	19.64	53.55	54	-0.45	AVG
		5461.25	45.63	19.64	65.27	68.2	-2.93	PK
	@	5530	85.98	19.61	105.59	N/A	N/A	PK
	@	5530	75.39	19.61	95	N/A	N/A	AVG
	*	11060	30.78	18.15	48.93	74	-25.07	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

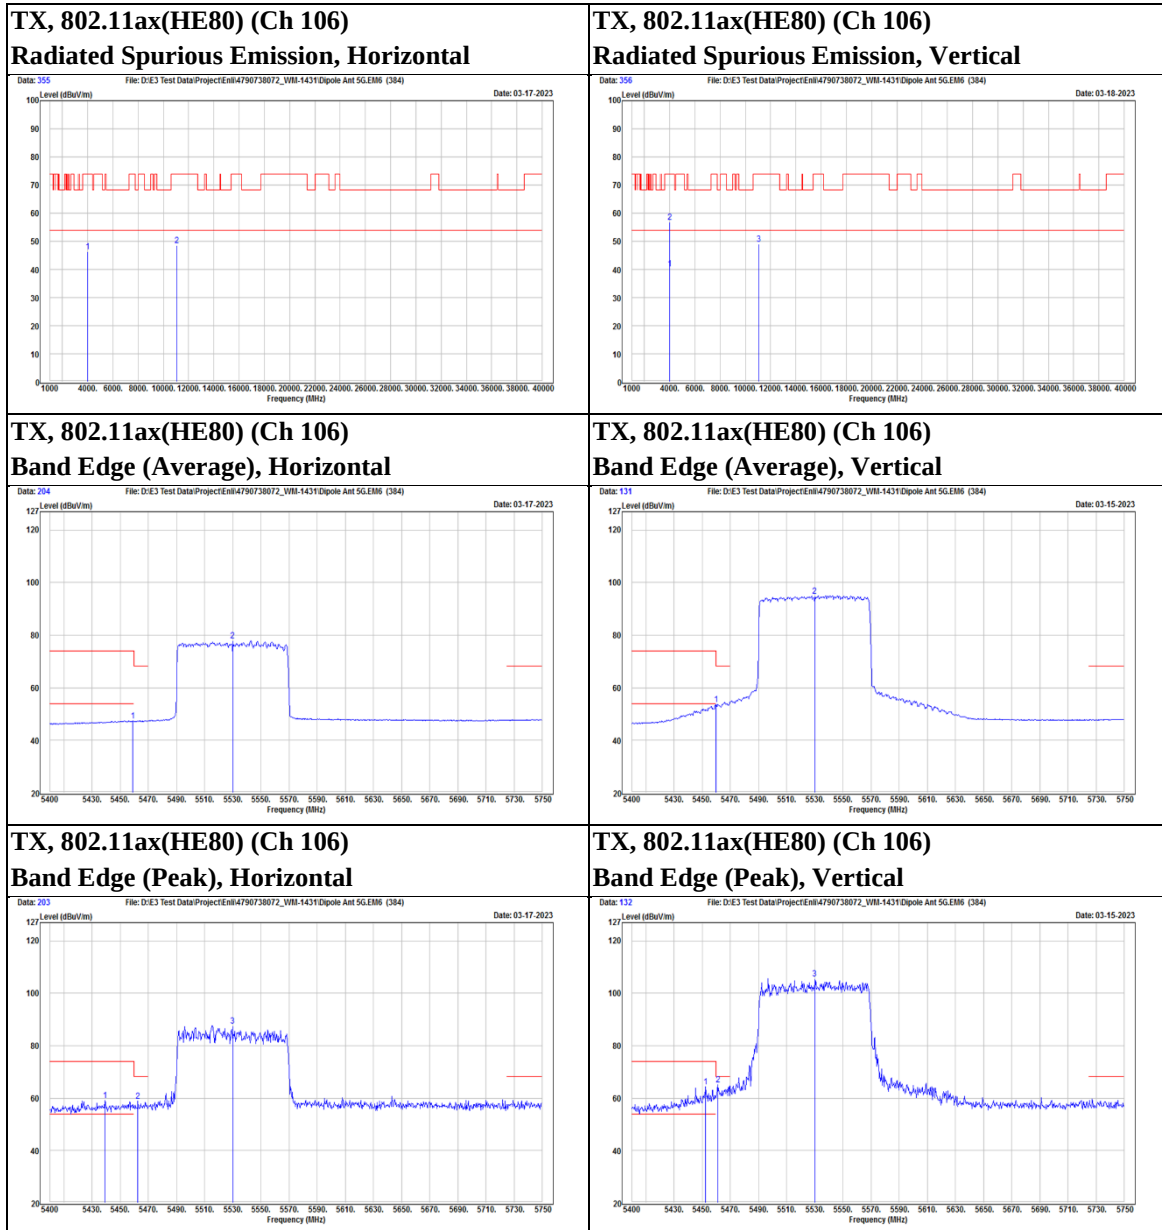

Mode	802.11ax(HE80)	Channel	122
------	----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	*	3992	45.61	0.05	45.66	74	-28.34	PK
		5450.4	27.64	19.62	47.26	54	-6.74	AVG
		5450.75	39.35	19.62	58.97	74	-15.03	PK
		5460.2	39.17	19.64	58.81	68.2	-9.39	PK
	@	5610	73.92	19.6	93.52	N/A	N/A	PK
	@	5610	62.22	19.6	81.82	N/A	N/A	AVG
		5746.85	39.51	20.02	59.53	68.2	-8.67	PK
	*	11220	30.54	17.92	48.46	74	-25.54	PK
Vertical		3992	56.4	0.05	56.45	74	-17.55	PK
		3992	39.64	0.05	39.69	54	-14.31	AVG
		5447.95	39.62	19.6	59.22	74	-14.78	PK
		5457.4	28.53	19.63	48.16	54	-5.84	AVG
		5467.55	40.56	19.65	60.21	68.2	-7.99	PK
	@	5610	91	19.6	110.6	N/A	N/A	PK
	@	5610	79.78	19.6	99.38	N/A	N/A	AVG
		5731.45	47.73	19.88	67.61	68.2	-0.59	PK
	*	11220	31.02	17.92	48.94	74	-25.06	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

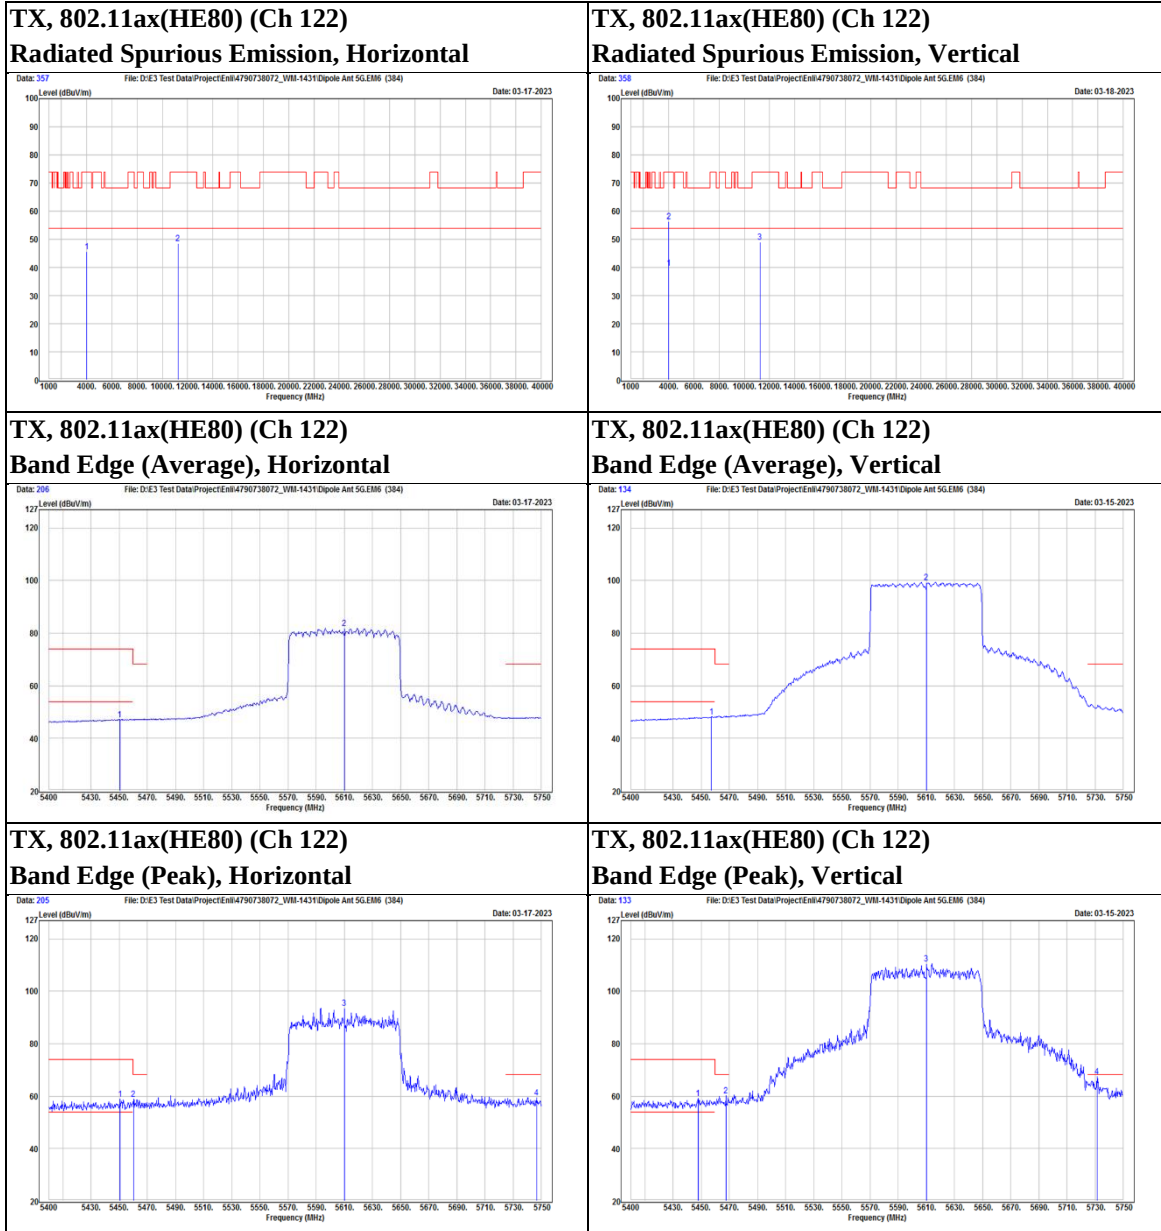

Mode	802.11ax(HE80)	Channel	138
------	----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	*	3992	45.48	0.05	45.53	74	-28.47	PK
	*	11380	34.09	18.39	52.48	74	-21.52	PK
Vertical		3992	55.85	0.05	55.9	74	-18.1	PK
		3992	35.92	0.05	35.97	54	-18.03	AVG
		11380	43.09	18.39	61.48	74	-12.52	PK
		11380	34.93	18.39	53.32	54	-0.68	AVG

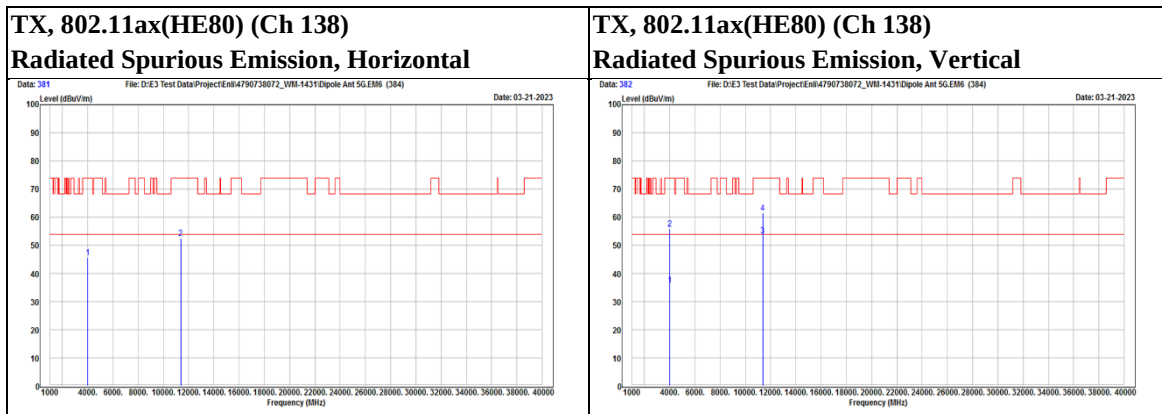

Mode	802.11ax(HE80)	Channel	155
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	3992	45.2	0.05	45.25	74	-28.75	PK
		5588.5	40.55	19.59	60.14	68.2	-8.06	PK
		5698	46.88	19.6	66.48	103.73	-37.25	PK
	@	5775	73.4	20.28	93.68	N/A	N/A	PK
		5875	41.31	20.68	61.99	105.2	-43.21	PK
		5935	40.52	20.74	61.26	68.2	-6.94	PK
	*	11550	32.18	18.73	50.91	74	-23.09	PK
Vertical		3992	55.92	0.05	55.97	74	-18.03	PK
		3992	39.28	0.05	39.33	54	-14.67	AVG
		5645.5	45.8	19.64	65.44	68.2	-2.76	PK
		5698	67.67	19.6	87.27	103.73	-16.46	PK
	@	5775	92.49	20.28	112.77	N/A	N/A	PK
		5875	59.21	20.68	79.89	105.2	-25.31	PK
		5926	46.69	20.73	67.42	68.2	-0.78	PK
		11550	35.62	18.73	54.35	74	-19.65	PK
		11550	29.58	18.73	48.31	54	-5.69	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

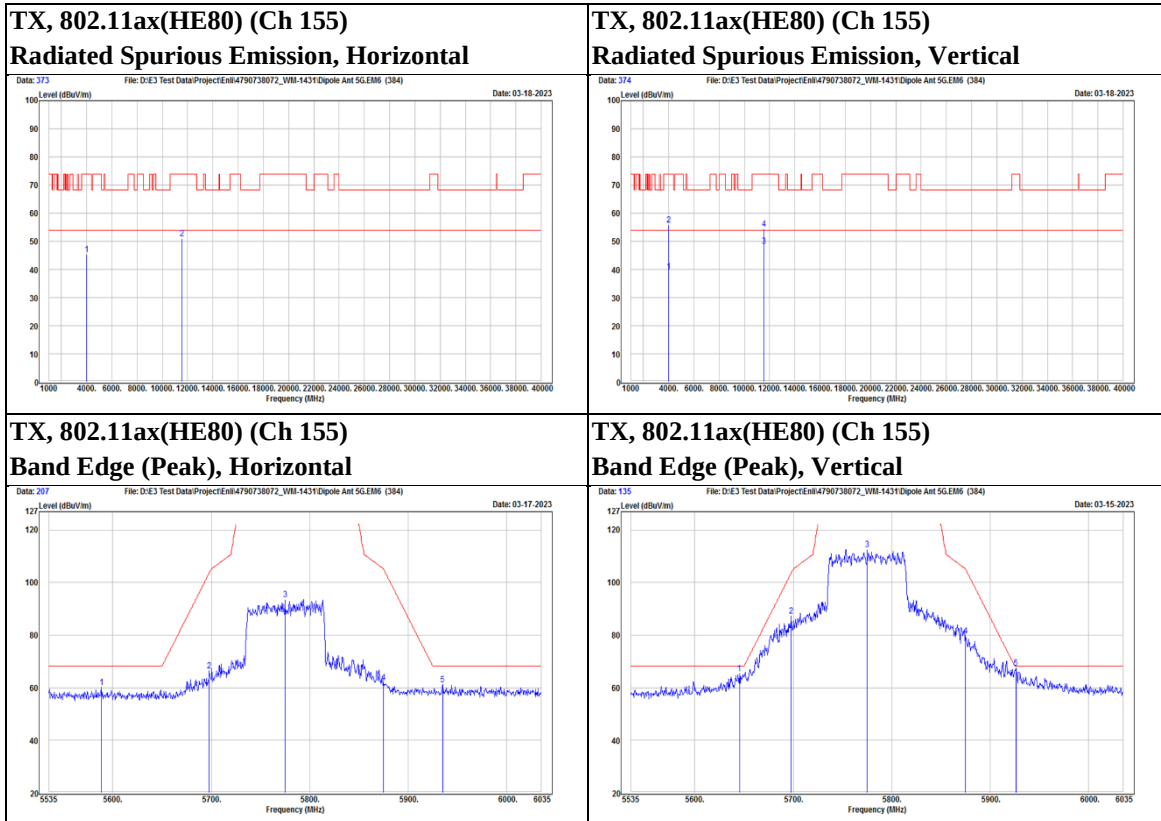

Mode	802.11ax(HE160)	Channel	50
------	-----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	*	3992	47.16	0.05	47.21	74	-26.79	PK
		5048.3	41.02	18.96	59.98	74	-14.02	PK
		5106.26	30.39	19.25	49.64	54	-4.36	AVG
	@	5250	66.69	18.95	85.64	N/A	N/A	PK
	@	5250	56.04	18.95	74.99	N/A	N/A	AVG
		5451.72	38.14	19.63	57.77	74	-16.23	PK
		5451.72	28.21	19.63	47.84	54	-6.16	AVG
	*	10500	30.16	17.61	47.77	68.2	-20.43	PK
Vertical		3992	56.93	0.05	56.98	74	-17.02	PK
		3992	40.37	0.05	40.42	54	-13.58	AVG
		5112.24	46.58	19.25	65.83	74	-8.17	PK
		5120.98	34.19	19.24	53.43	54	-0.57	AVG
	@	5250	81.31	18.95	100.26	N/A	N/A	PK
	@	5250	71.2	18.95	90.15	N/A	N/A	AVG
		5391.92	31.33	19.09	50.42	54	-3.58	AVG
		5401.58	41.45	19.18	60.63	74	-13.37	PK
	*	10500	30.38	17.61	47.99	68.2	-20.21	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

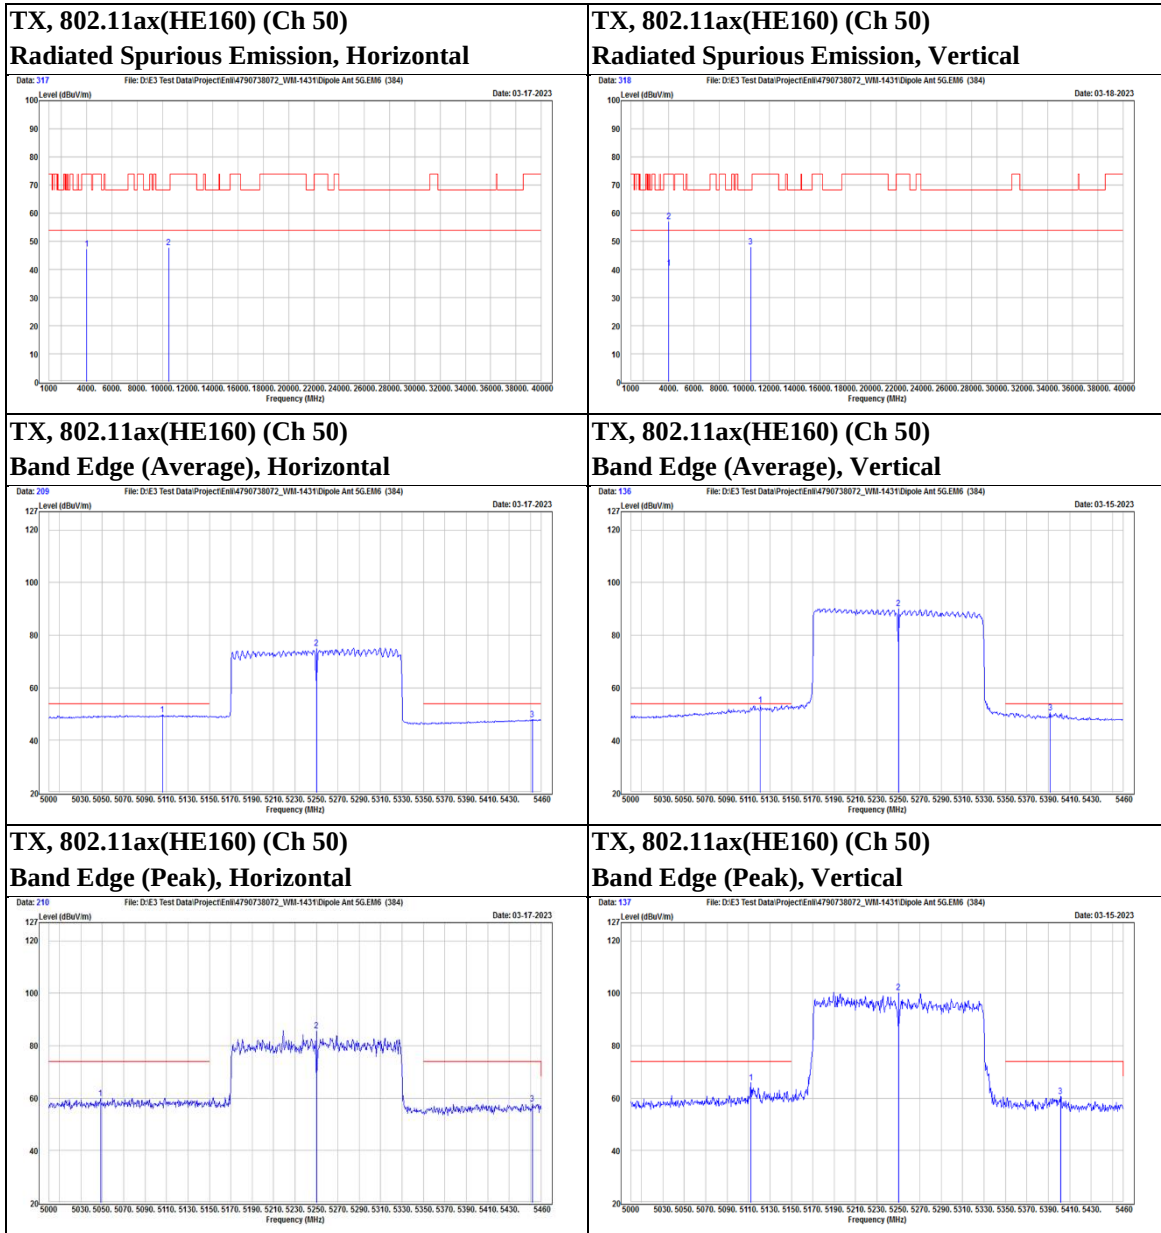


Mode	802.11ax(HE160)	Channel	114
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5452.15	39.08	19.63	58.71	74	-15.29	PK
		5455.65	28.37	19.63	48	54	-6	AVG
		5469.3	38.77	19.65	58.42	68.2	-9.78	PK
	@	5570	64.76	19.56	84.32	N/A	N/A	PK
	@	5570	54.71	19.56	74.27	N/A	N/A	AVG
		5745.1	39.65	20.01	59.66	68.2	-8.54	PK
Vertical		5432.55	46.36	19.47	65.83	74	-8.17	PK
		5436.4	33.88	19.5	53.38	54	-0.62	AVG
		5465.45	42.58	19.65	62.23	68.2	-5.97	PK
	@	5570	82.26	19.56	101.82	N/A	N/A	PK
	@	5570	72.13	19.56	91.69	N/A	N/A	AVG
		5726.9	46.84	19.85	66.69	68.2	-1.51	PK


TX, 802.11ax(HE160) (Ch 114)
Band Edge (Average), Horizontal

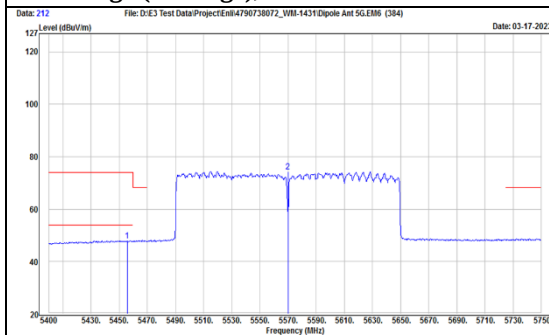


TX, 802.11ax(HE160) (Ch 114)
Band Edge (Average), Vertical

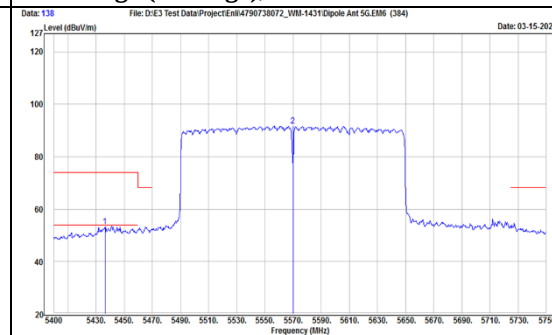

TX, 802.11ax(HE160) (Ch 114)
Band Edge (Peak), Horizontal

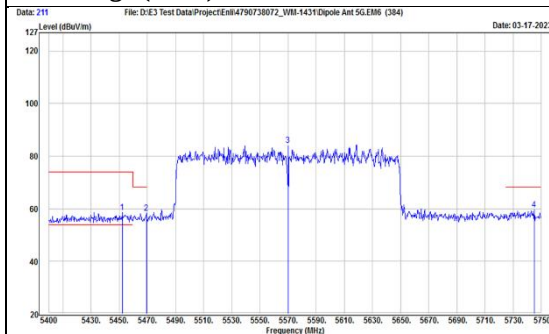

TX, 802.11ax(HE160) (Ch 114)
Band Edge (Peak), Vertical

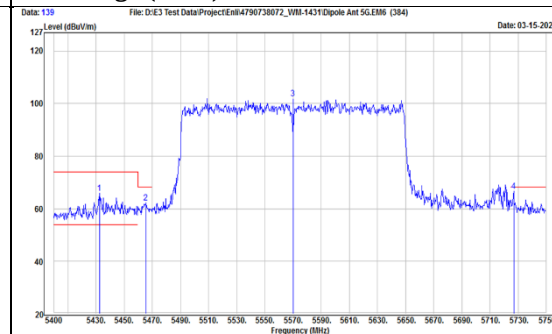


Below 1 GHz


Mode	802.11ax(HE40)	Channel	159
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		68.8	48.42	-13.92	34.5	40	-5.5	PK
		99.84	57.41	-16.35	41.06	43.5	-2.44	PK
		109.54	50.94	-14.78	36.16	43.5	-7.34	PK
		148.34	45.22	-11.95	33.27	43.5	-10.23	PK
		299.66	55.76	-10.7	45.06	46	-0.94	PK
		472.32	42.75	-5.81	36.94	46	-9.06	PK
Vertical		50.37	51.04	-11.86	39.18	40	-0.82	PK
		68.8	52.72	-13.92	38.8	40	-1.2	PK
		99.84	56.83	-16.35	40.48	43.5	-3.02	PK
		148.34	45.44	-11.95	33.49	43.5	-10.01	PK
		299.66	50.59	-10.7	39.89	46	-6.11	PK
		450.98	44.12	-6.26	37.86	46	-8.14	PK

TX, 802.11ax(HE40) (Ch 159) Radiated Spurious Emission, Horizontal

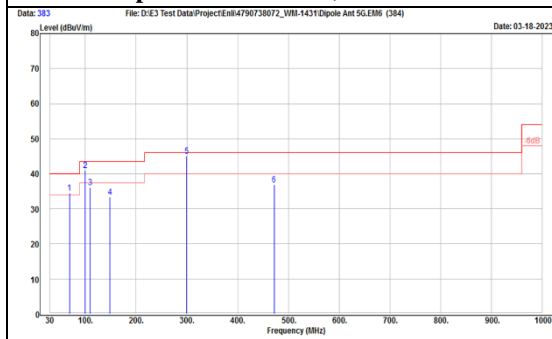

TX, 802.11ax(HE40) (Ch 159) Radiated Spurious Emission, Vertical

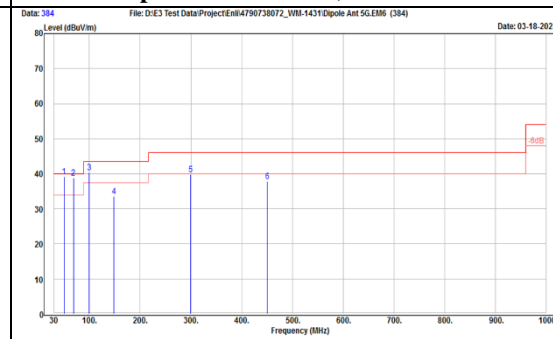

Panel Antenna

Above 1 GHz

Mode	802.11a	Channel	36
------	---------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	*	3992	46.19	0.05	46.24	74	-27.76	PK
		5144.2	46.58	19.22	65.8	74	-8.2	PK
		5149.8	32.99	19.22	52.21	54	-1.79	AVG
	@	5180	94.64	19.14	113.78	N/A	N/A	PK
	@	5180	85.67	19.14	104.81	N/A	N/A	AVG
	*	10360	32.5	17.03	49.53	68.2	-18.67	PK
Vertical		3992	55.7	0.05	55.75	74	-18.25	PK
		3992	39.07	0.05	39.12	54	-14.88	AVG
		5148.75	45.13	19.22	64.35	74	-9.65	PK
		5149.45	30.91	19.22	50.13	54	-3.87	AVG
	@	5180	88.62	19.14	107.76	N/A	N/A	PK
	@	5180	80.66	19.14	99.8	N/A	N/A	AVG
	*	10360	33.05	17.03	50.08	68.2	-18.12	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

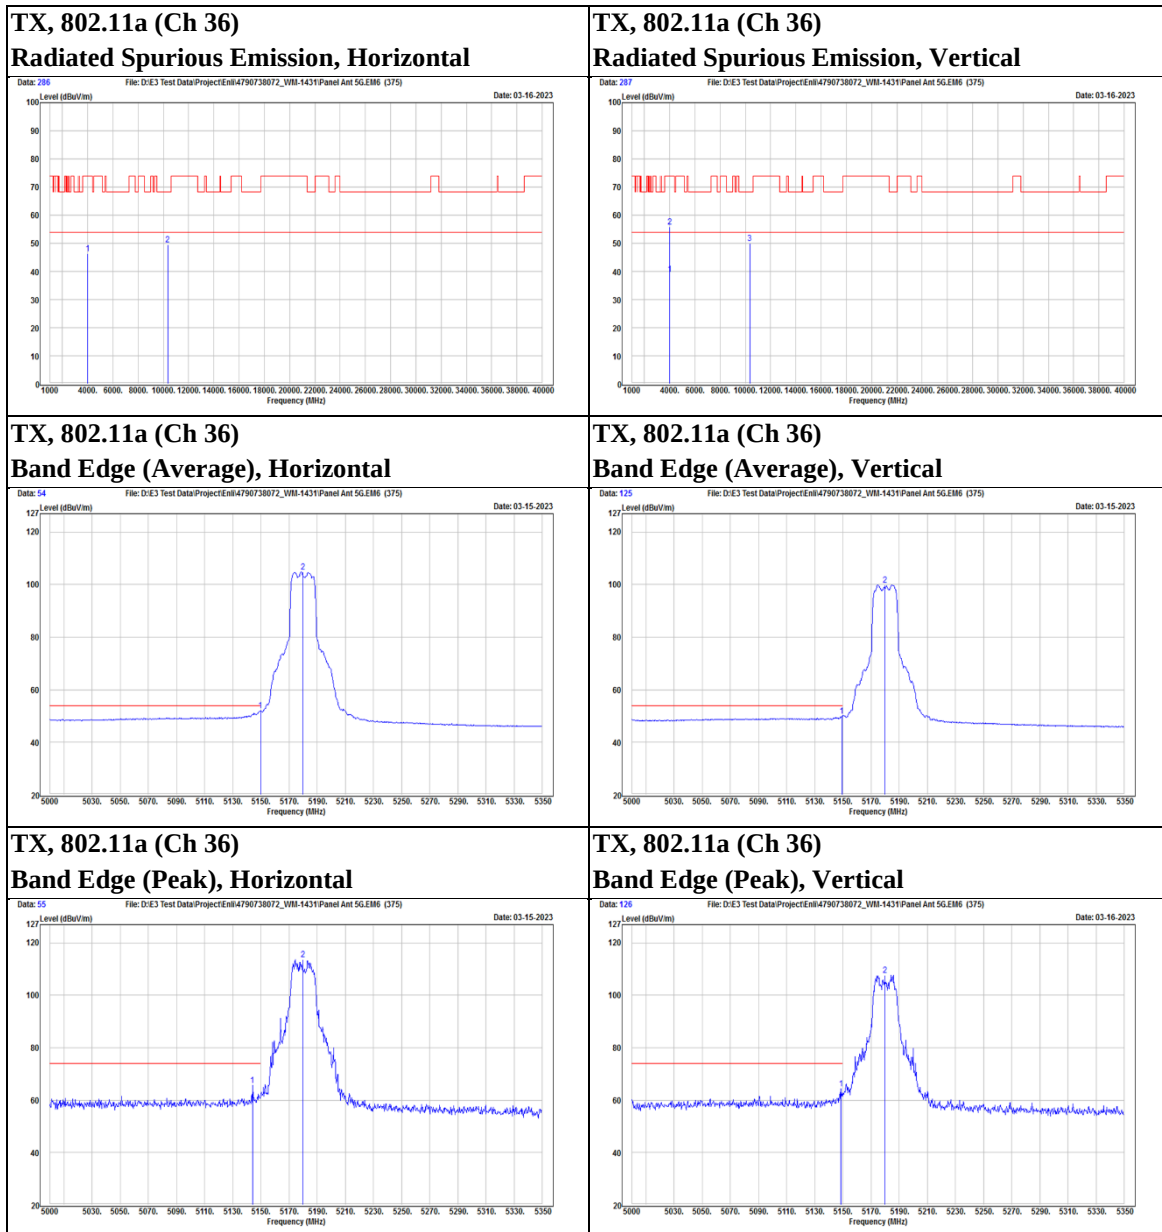

Mode	802.11a	Channel	44
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	3992	44.06	0.05	44.11	74	-29.89	PK
		5071.05	42.87	19.09	61.96	74	-12.04	PK
		5140.35	30.08	19.23	49.31	54	-4.69	AVG
	@	5220	94.83	19.04	113.87	N/A	N/A	PK
	@	5220	85.95	19.04	104.99	N/A	N/A	AVG
	*	10440	30.51	17.45	47.96	68.2	-20.24	PK
Vertical		3992	55.92	0.05	55.97	74	-18.03	PK
		3992	39.31	0.05	39.36	54	-14.64	AVG
		5078.05	42.37	19.13	61.5	74	-12.5	PK
		5135.8	30.17	19.23	49.4	54	-4.6	AVG
	@	5220	90.59	19.04	109.63	N/A	N/A	PK
	@	5220	82.05	19.04	101.09	N/A	N/A	AVG
	*	10440	31.16	17.45	48.61	68.2	-19.59	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

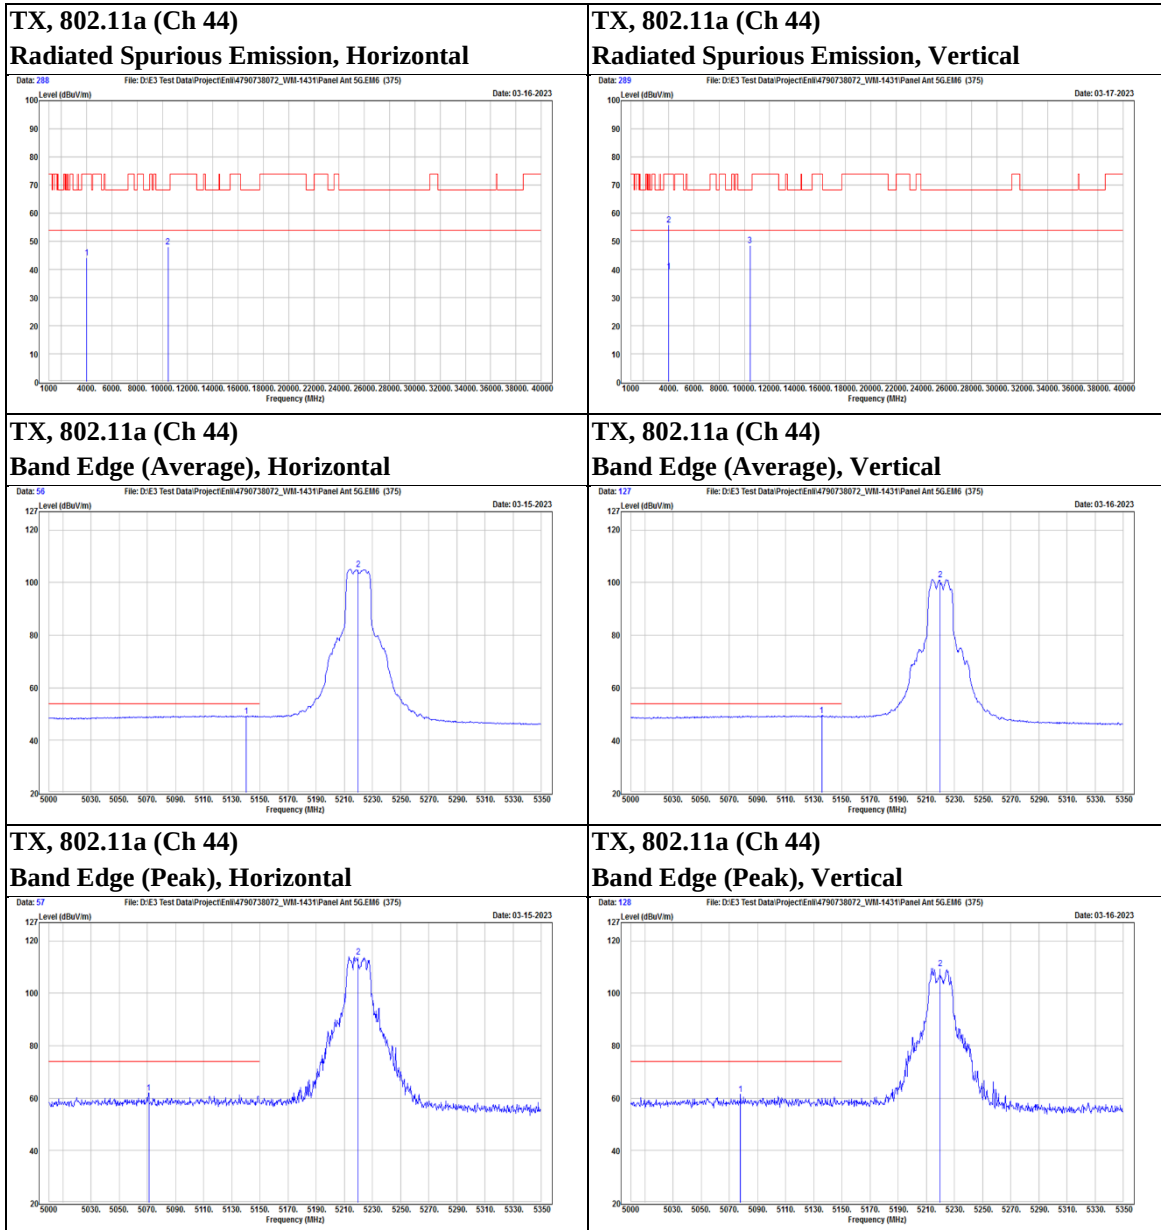

Mode	802.11a	Channel	48
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	3992	45.23	0.05	45.28	74	-28.72	PK
		5148.05	44.26	19.22	63.48	74	-10.52	PK
		5149.8	33.53	19.22	52.75	54	-1.25	AVG
	@	5240	98.53	18.99	117.52	N/A	N/A	PK
	@	5240	89.53	18.99	108.52	N/A	N/A	AVG
	*	10480	30.92	17.55	48.47	68.2	-19.73	PK
Vertical		3992	55.92	0.05	55.97	74	-18.03	PK
		3992	39.2	0.05	39.25	54	-14.75	AVG
		5148.4	42.54	19.22	61.76	74	-12.24	PK
		5149.45	30.84	19.22	50.06	54	-3.94	AVG
	@	5240	95.98	18.99	114.97	N/A	N/A	PK
	@	5240	85.38	18.99	104.37	N/A	N/A	AVG
	*	10480	30.63	17.55	48.18	68.2	-20.02	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

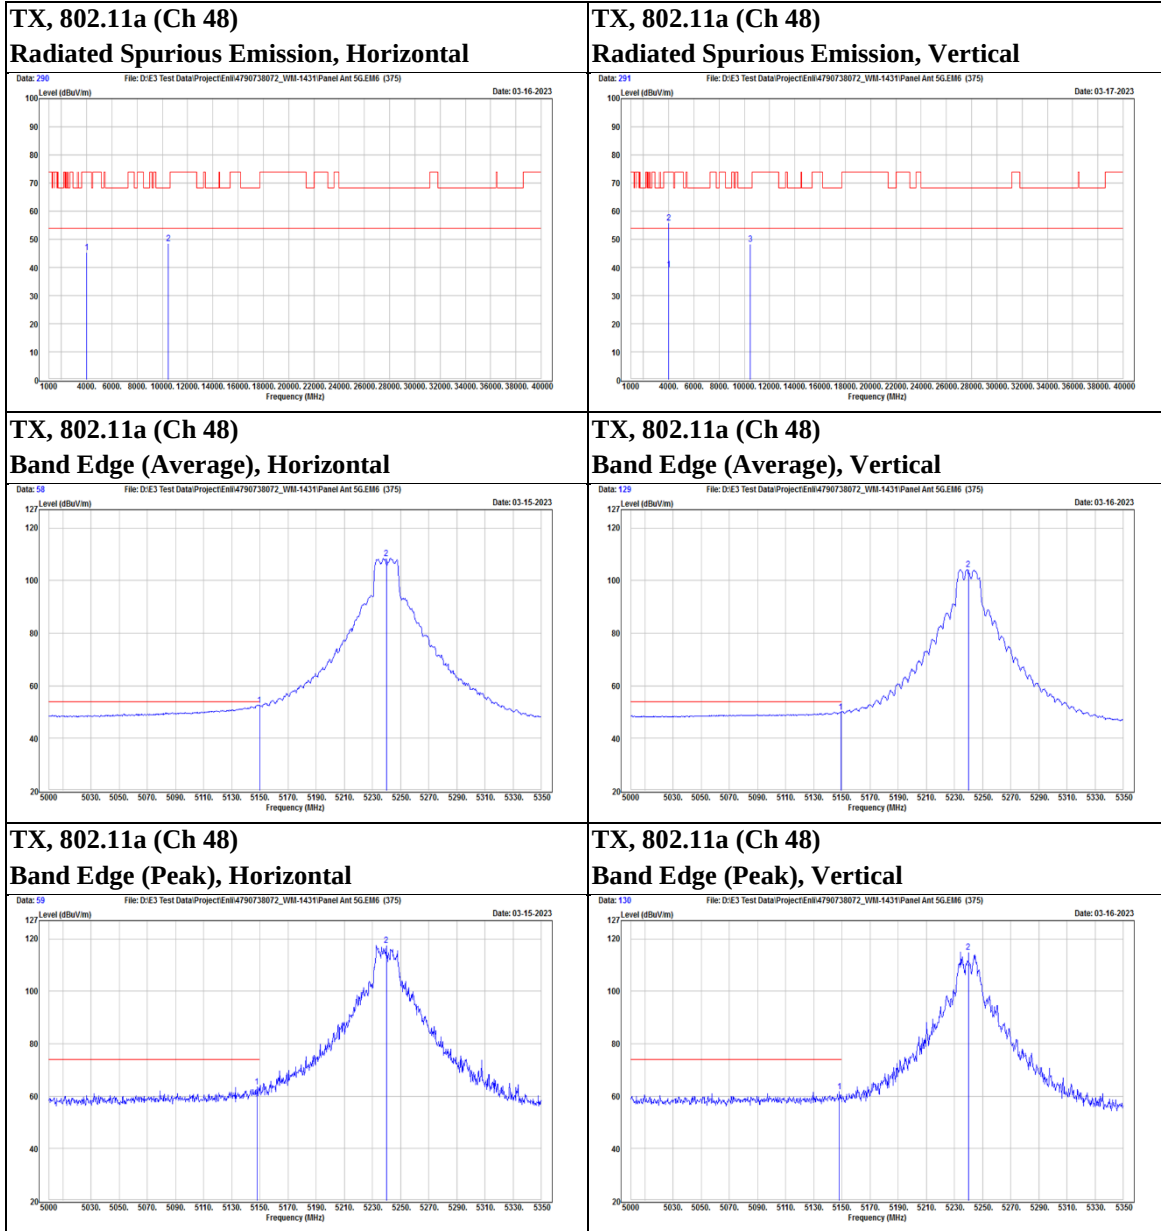

Mode	802.11a	Channel	52
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	3992	43.79	0.05	43.84	74	-30.16	PK
	@	5260	99.12	18.91	118.03	N/A	N/A	PK
	@	5260	89.37	18.91	108.28	N/A	N/A	AVG
		5352	45.01	18.72	63.73	74	-10.27	PK
		5352.9	31.81	18.72	50.53	54	-3.47	AVG
	*	10520	31.28	17.63	48.91	68.2	-19.29	PK
Vertical		3992	54.91	0.05	54.96	74	-19.04	PK
		3992	38.3	0.05	38.35	54	-15.65	AVG
	@	5260	94	18.91	112.91	N/A	N/A	PK
	@	5260	85.08	18.91	103.99	N/A	N/A	AVG
		5350.2	30.06	18.7	48.76	54	-5.24	AVG
		5359.2	45.73	18.78	64.51	74	-9.49	PK
	*	10520	35.26	17.63	52.89	68.2	-15.31	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

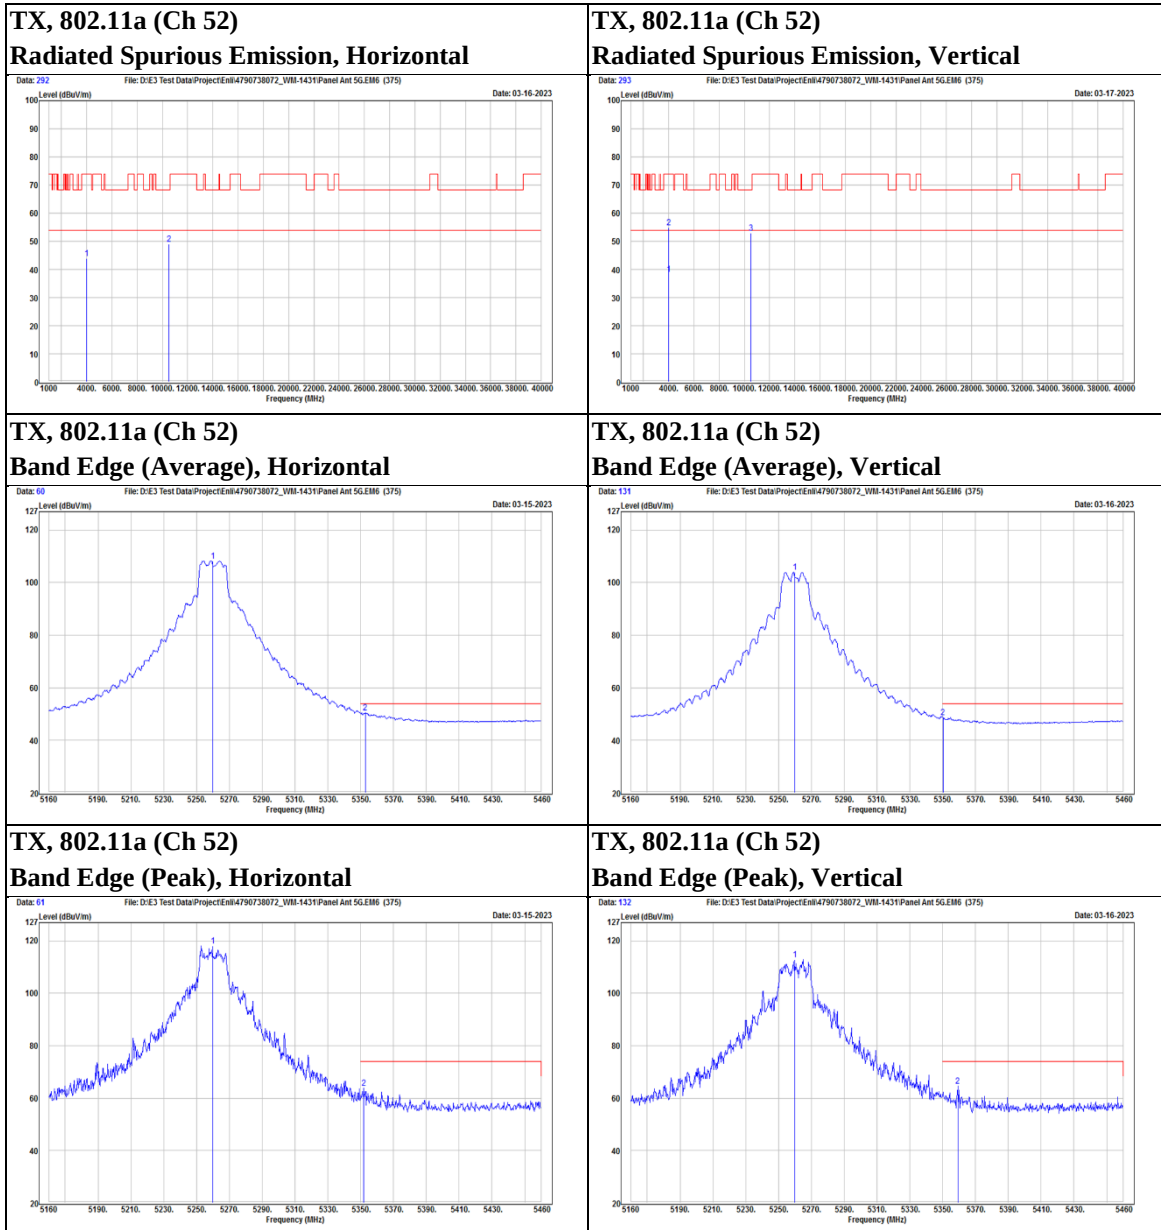

Mode	802.11a	Channel	60
------	---------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	*	3992	44.29	0.05	44.34	74	-29.66	PK
	@	5300	95.06	18.73	113.79	N/A	N/A	PK
	@	5300	85.84	18.73	104.57	N/A	N/A	AVG
		5350.2	30.32	18.7	49.02	54	-4.98	AVG
		5367.3	40.44	18.85	59.29	74	-14.71	PK
	*	10600	30.84	17.71	48.55	74	-25.45	PK
Vertical		3992	54.93	0.05	54.98	74	-19.02	PK
		3992	38.38	0.05	38.43	54	-15.57	AVG
	@	5300	91.35	18.73	110.08	N/A	N/A	PK
	@	5300	81.96	18.73	100.69	N/A	N/A	AVG
		5453.4	27.8	19.63	47.43	54	-6.57	AVG
		5456.4	39.19	19.63	58.82	74	-15.18	PK
	*	10600	31.13	17.71	48.84	74	-25.16	PK

Underwriters Laboratories Taiwan Co., Ltd.


Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000


Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1


TX, 802.11a (Ch 60)
Radiated Spurious Emission, Horizontal

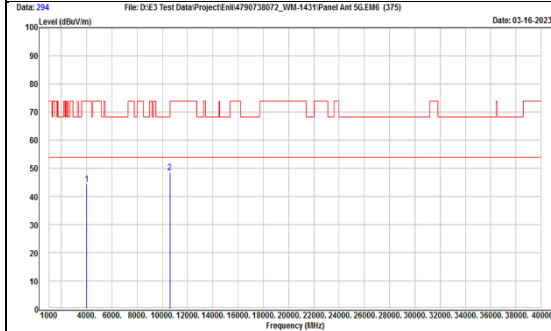


TX, 802.11a (Ch 60)
Radiated Spurious Emission, Vertical

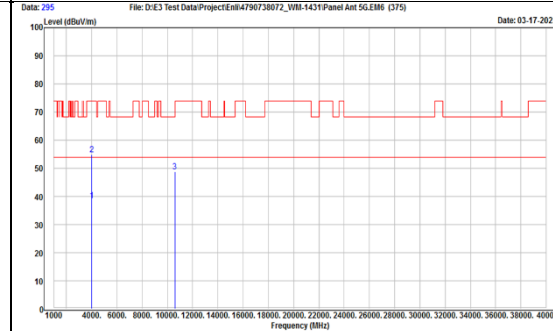


TX, 802.11a (Ch 60)
Band Edge (Average), Horizontal

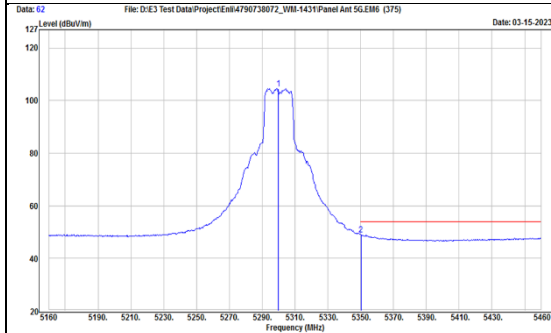


TX, 802.11a (Ch 60)
Band Edge (Average), Vertical

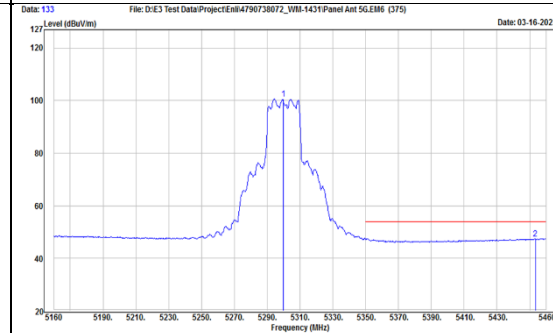

TX, 802.11a (Ch 60)
Band Edge (Peak), Horizontal

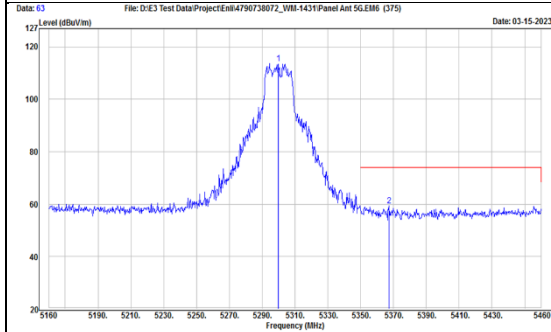

TX, 802.11a (Ch 60)
Band Edge (Peak), Vertical

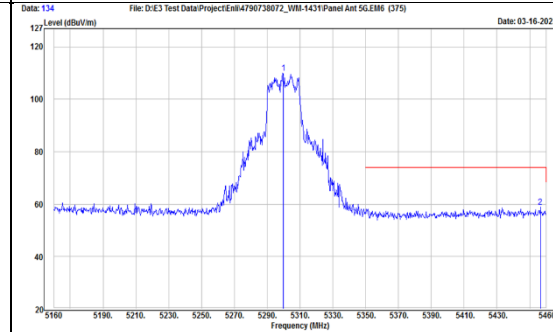

Mode	802.11a	Channel	64
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	3992	44.68	0.05	44.73	74	-29.27	PK
	@	5320	92.53	18.72	111.25	N/A	N/A	PK
	@	5320	83.79	18.72	102.51	N/A	N/A	AVG
		5350.2	34.56	18.7	53.26	54	-0.74	AVG
		5352.9	48.08	18.72	66.8	74	-7.2	PK
	*	10640	30.42	17.67	48.09	74	-25.91	PK
Vertical		3992	54.21	0.05	54.26	74	-19.74	PK
		3992	37.61	0.05	37.66	54	-16.34	AVG
	@	5320	89.11	18.72	107.83	N/A	N/A	PK
	@	5320	79.64	18.72	98.36	N/A	N/A	AVG
		5350.2	29.37	18.7	48.07	54	-5.93	AVG
		5350.5	40.39	18.7	59.09	74	-14.91	PK
	*	10640	31.25	17.67	48.92	74	-25.08	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

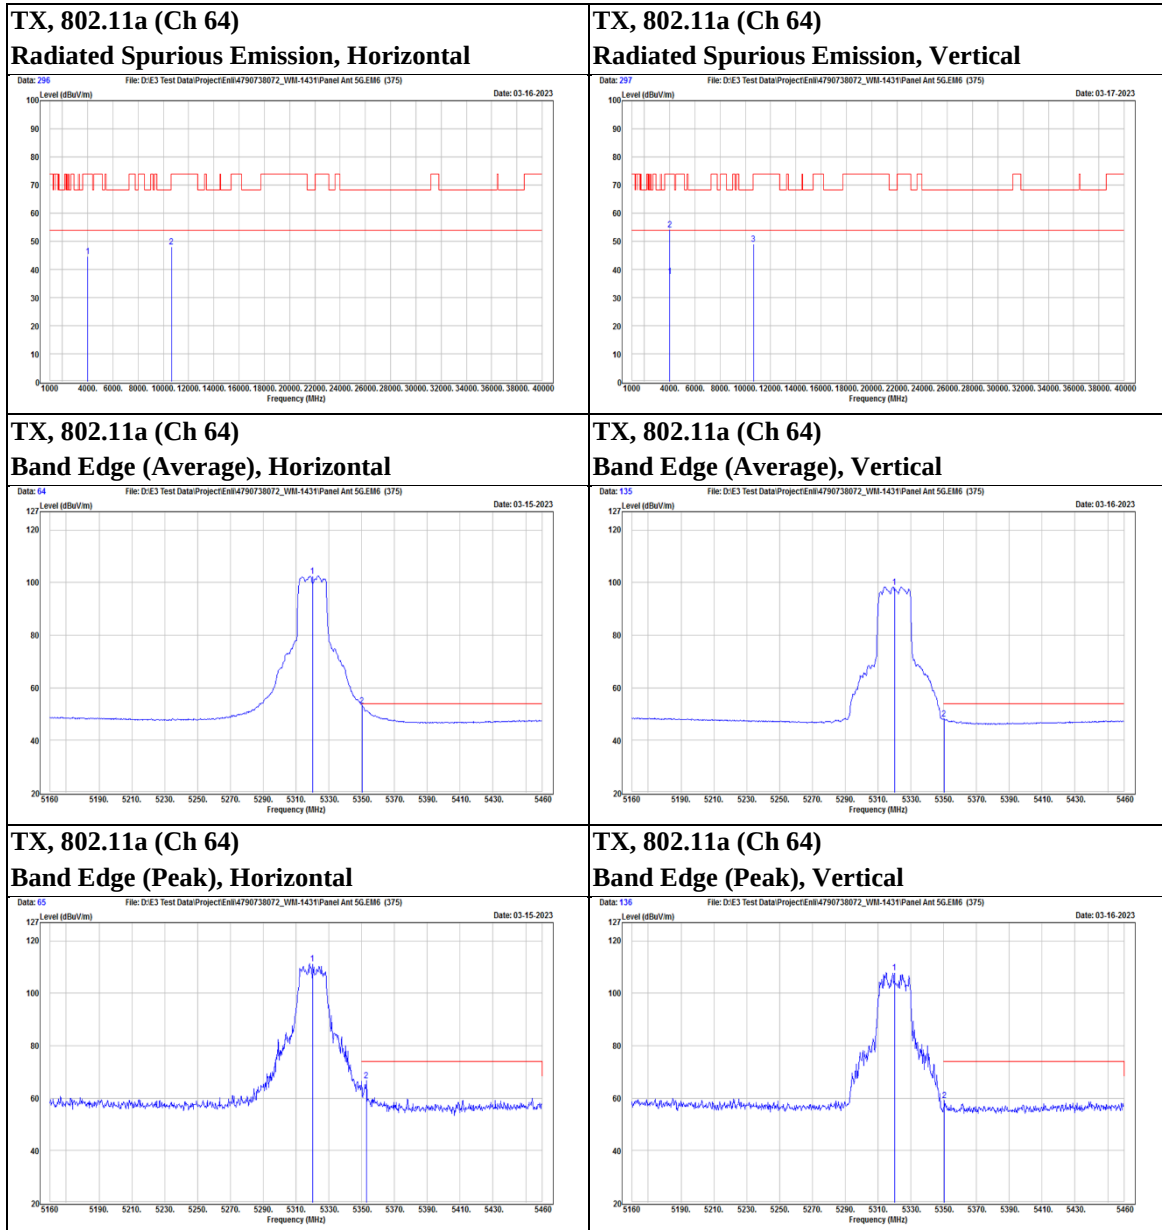

Mode	802.11a	Channel	100
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	3992	43.54	0.05	43.59	74	-30.41	PK
		5459.5	41.31	19.64	60.95	74	-13.05	PK
		5459.5	30.49	19.64	50.13	54	-3.87	AVG
		5467.55	48.08	19.65	67.73	68.2	-0.47	PK
	@	5500	93.7	19.69	113.39	N/A	N/A	PK
	@	5500	84.2	19.69	103.89	N/A	N/A	AVG
	*	11000	30.68	17.88	48.56	74	-25.44	PK
Vertical		3992	54.76	0.05	54.81	74	-19.19	PK
		3992	38.14	0.05	38.19	54	-15.81	AVG
		5459.85	40.14	19.64	59.78	74	-14.22	PK
		5459.85	29.24	19.64	48.88	54	-5.12	AVG
		5470	44.59	19.65	64.24	68.2	-3.96	PK
	@	5500	90.07	19.69	109.76	N/A	N/A	PK
	@	5500	81.13	19.69	100.82	N/A	N/A	AVG
	*	11000	32.27	17.88	50.15	74	-23.85	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

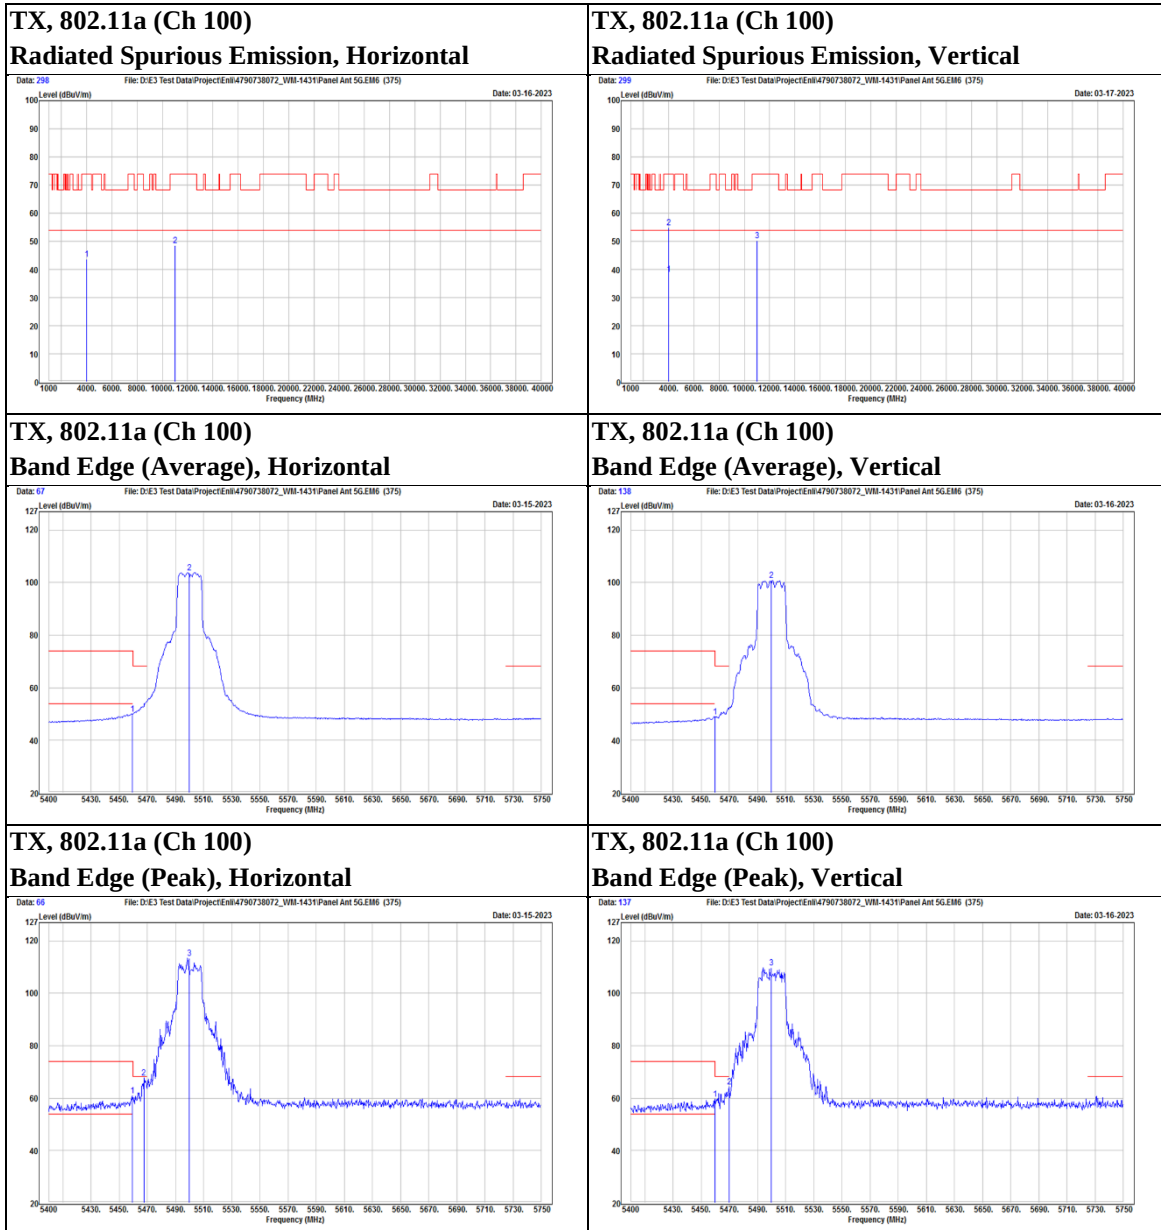

Mode	802.11a	Channel	116
------	---------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	*	3992	42.67	0.05	42.72	74	-31.28	PK
		5450.75	40.75	19.62	60.37	74	-13.63	PK
		5459.85	29.02	19.64	48.66	54	-5.34	AVG
		5462.65	40.49	19.64	60.13	68.2	-8.07	PK
	@	5580	96.81	19.58	116.39	N/A	N/A	PK
	@	5580	88.77	19.58	108.35	N/A	N/A	AVG
		5728.3	40.05	19.86	59.91	68.2	-8.29	PK
	*	11160	33.09	18.05	51.14	74	-22.86	PK
Vertical		3992	55.7	0.05	55.75	74	-18.25	PK
		3992	39.12	0.05	39.17	54	-14.83	AVG
		5442	39.67	19.56	59.23	74	-14.77	PK
		5459.85	28.39	19.64	48.03	54	-5.97	AVG
		5467.55	38.88	19.65	58.53	68.2	-9.67	PK
	@	5580	94.84	19.58	114.42	N/A	N/A	PK
	@	5580	85.23	19.58	104.81	N/A	N/A	AVG
		5744.05	39.49	20	59.49	68.2	-8.71	PK
		11160	41.59	18.05	59.64	74	-14.36	PK
		11160	35.52	18.05	53.57	54	-0.43	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

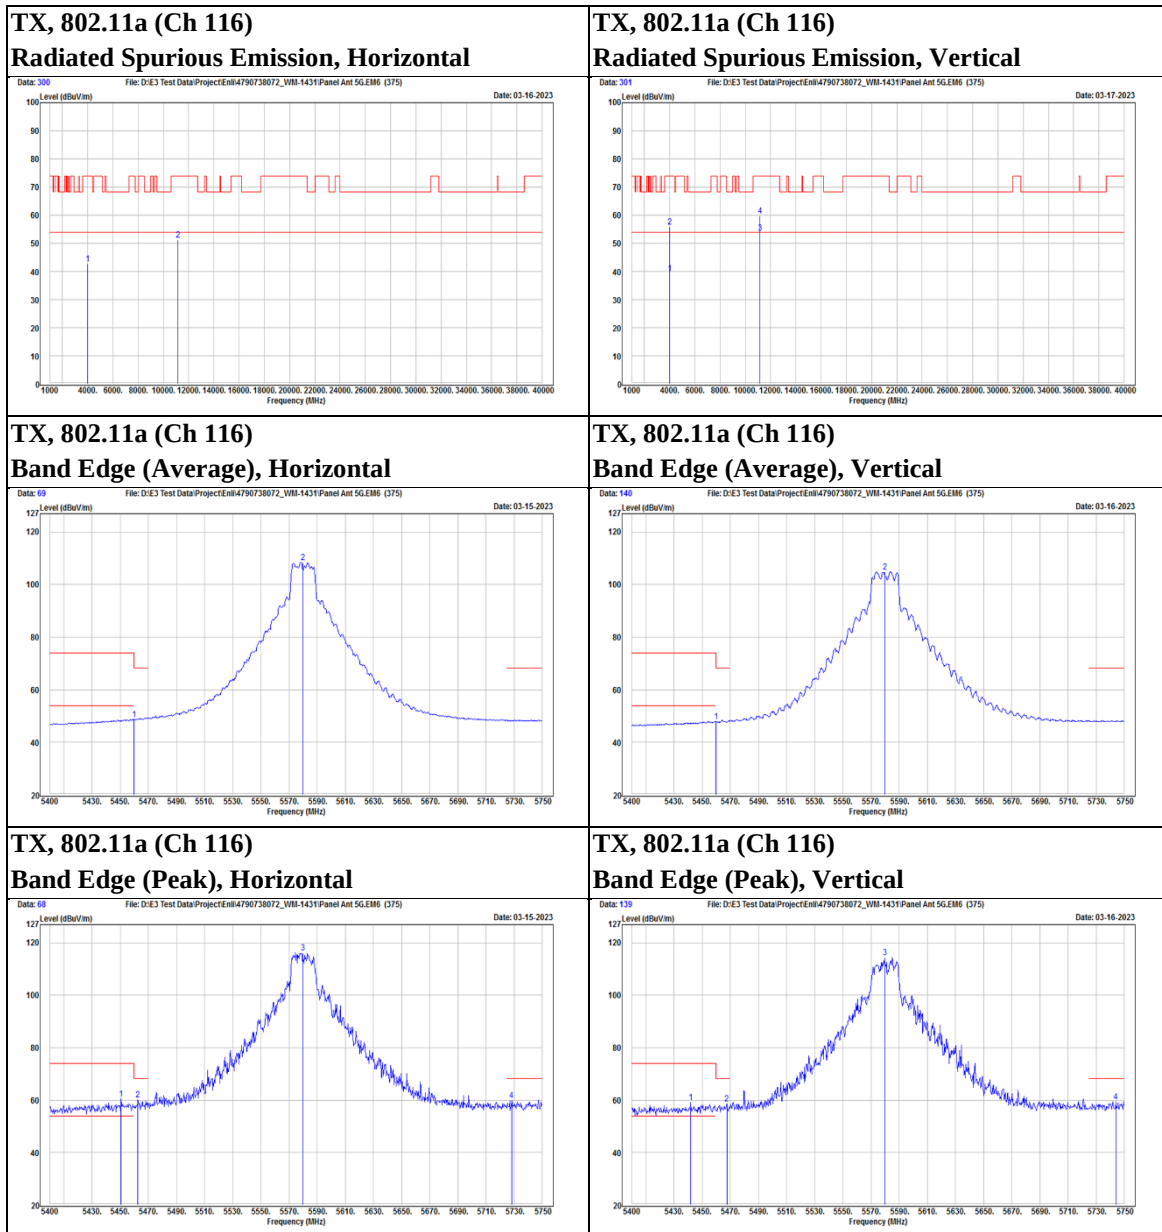

Mode	802.11a	Channel	140
------	---------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	*	3992	44.03	0.05	44.08	74	-29.92	PK
		5448.65	40.14	19.61	59.75	74	-14.25	PK
		5453.55	28.75	19.63	48.38	54	-5.62	AVG
	@	5700	91.42	19.6	111.02	N/A	N/A	PK
	@	5700	83.09	19.6	102.69	N/A	N/A	AVG
		5725.15	47.88	19.83	67.71	68.2	-0.49	PK
	*	11400	29.59	18.46	48.05	74	-25.95	PK
Vertical		3992	55.37	0.05	55.42	74	-18.58	PK
		3992	38.76	0.05	38.81	54	-15.19	AVG
		5452.5	38.86	19.63	58.49	74	-15.51	PK
		5456.35	27.63	19.63	47.26	54	-6.74	AVG
	@	5700	88.43	19.6	108.03	N/A	N/A	PK
	@	5700	77.82	19.6	97.42	N/A	N/A	AVG
		5725	44.76	19.83	64.59	68.2	-3.61	PK
	*	11400	30.36	18.46	48.82	74	-25.18	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000


Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

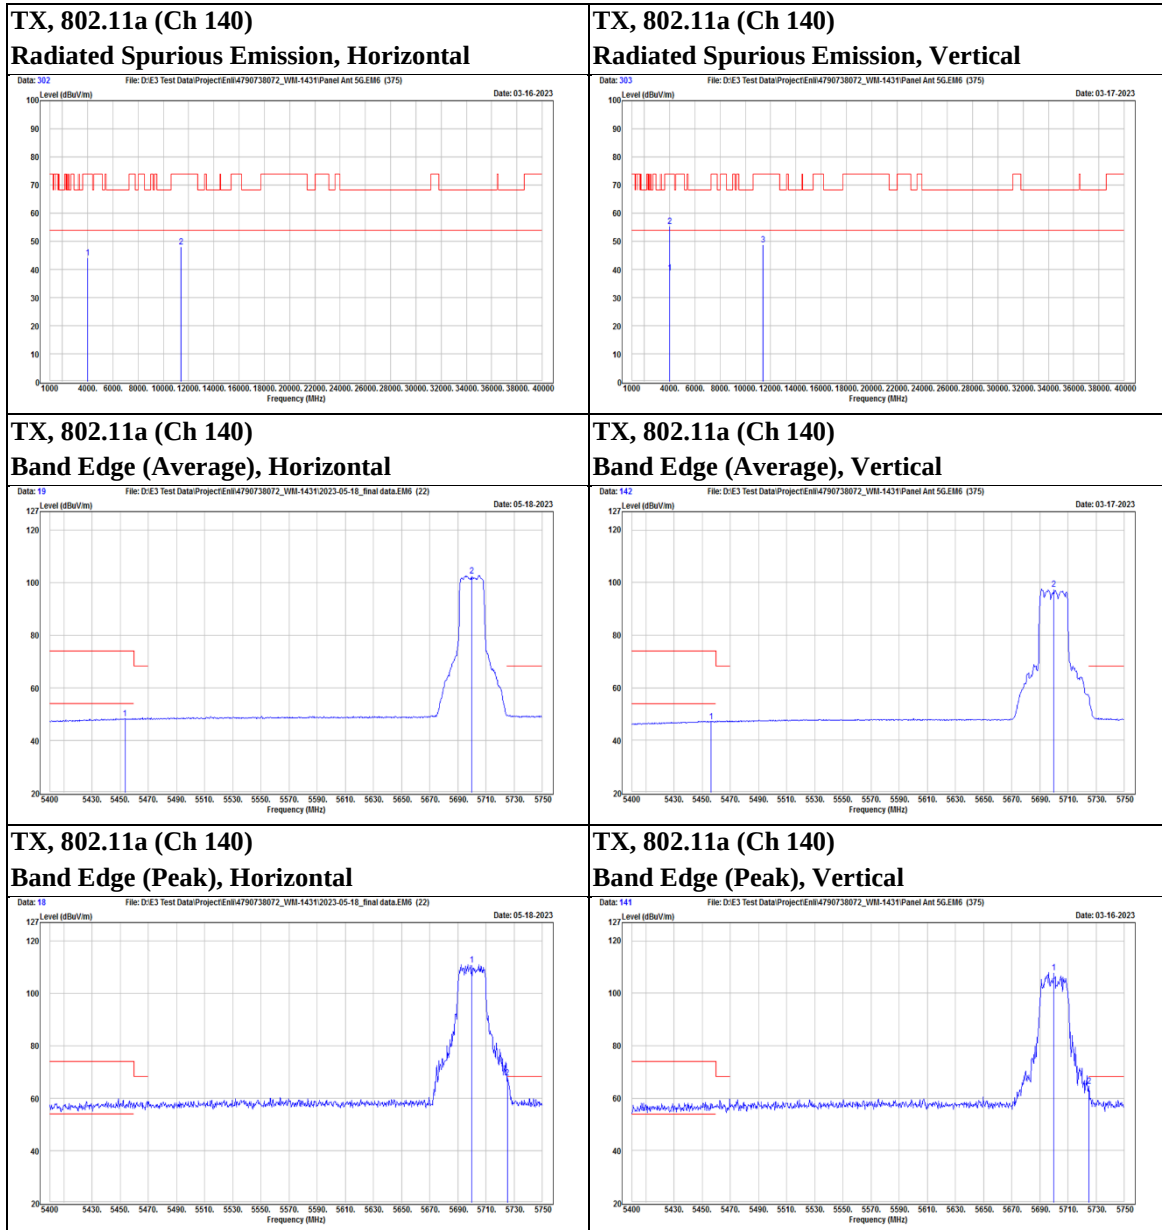


Mode	802.11a	Channel	144
------	---------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	*	3992	49.74	0.05	49.79	74	-24.21	PK
	*	11440	31.29	18.63	49.92	74	-24.08	PK
Vertical		3992	56.32	0.05	56.37	74	-17.63	PK
		3992	35.75	0.05	35.8	54	-18.2	AVG
	*	11440	35.31	18.63	53.94	74	-20.06	PK

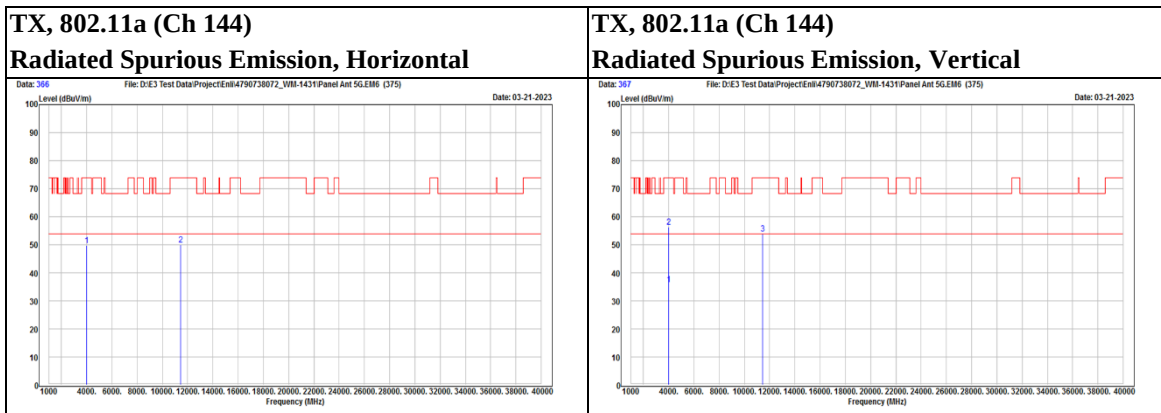

Mode	802.11a	Channel	149
------	---------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	*	3992	43.62	0.05	43.67	74	-30.33	PK
		5628	40.81	19.62	60.43	68.2	-7.77	PK
		5698	41.37	19.6	60.97	103.73	-42.76	PK
	@	5745	94.29	20.01	114.3	N/A	N/A	PK
	*	11490	30.89	18.86	49.75	74	-24.25	PK
Vertical		3992	56.06	0.05	56.11	74	-17.89	PK
		3992	39.47	0.05	39.52	54	-14.48	AVG
		5542.5	40.56	19.56	60.12	68.2	-8.08	PK
		5692.5	40.99	19.61	60.6	99.67	-39.07	PK
	@	5745	92.96	20.01	112.97	N/A	N/A	PK
		11490	40.99	18.86	59.85	74	-14.15	PK
		11490	30.43	18.86	49.29	54	-4.71	AVG

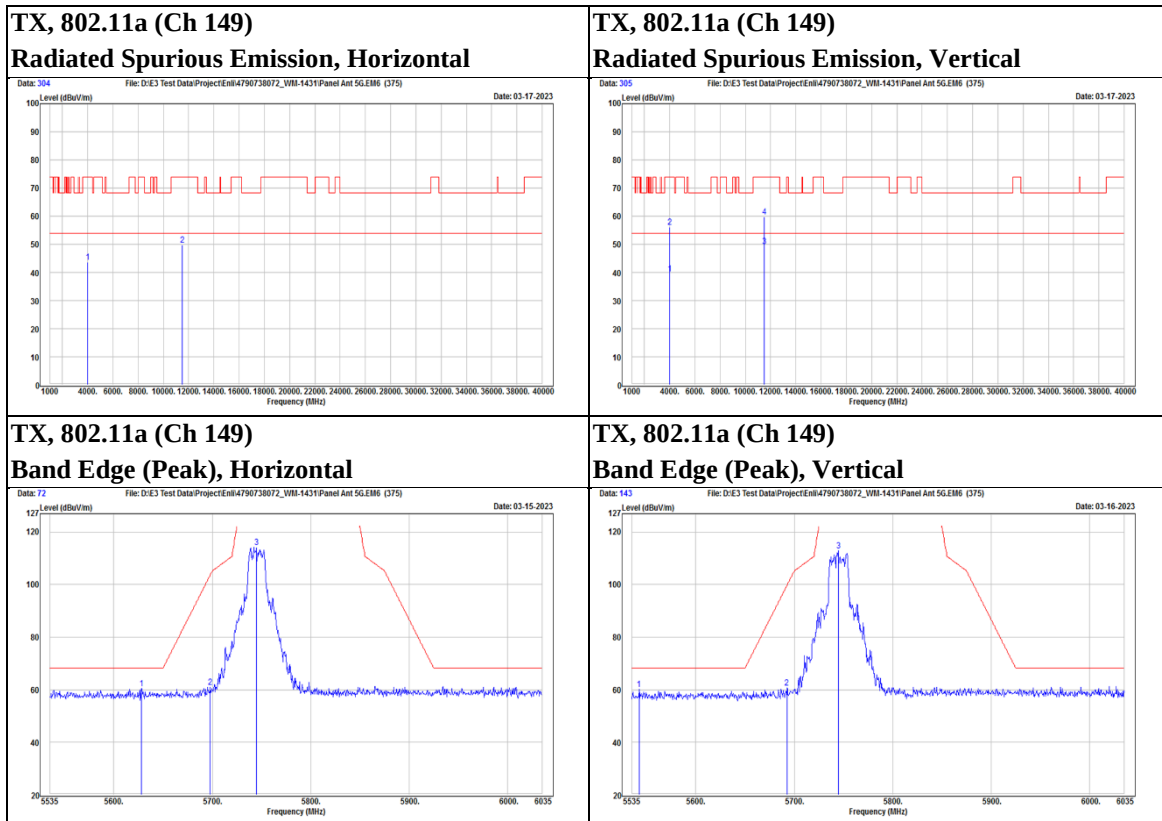

Mode	802.11a	Channel	157
------	---------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	*	3992	46.28	0.05	46.33	74	-27.67	PK
		5585.5	40.67	19.58	60.25	68.2	-7.95	PK
		5654.5	39.76	19.64	59.4	71.54	-12.14	PK
	@	5785	95.88	20.37	116.25	N/A	N/A	PK
		5886.5	40.78	20.69	61.47	96.66	-35.19	PK
		5931	40.81	20.73	61.54	68.2	-6.66	PK
	*	11570	32.11	18.65	50.76	74	-23.24	PK
Vertical		3992	56.36	0.05	56.41	74	-17.59	PK
		3992	39.74	0.05	39.79	54	-14.21	AVG
		5569.5	39.75	19.56	59.31	68.2	-8.89	PK
		5667.5	39.73	19.63	59.36	81.19	-21.83	PK
	@	5785	90.83	20.37	111.2	N/A	N/A	PK
		5919.5	39.85	20.72	60.57	72.25	-11.68	PK
		5960	40.76	20.77	61.53	68.2	-6.67	PK
		11570	38.06	18.65	56.71	74	-17.29	PK
		11570	27.5	18.65	46.15	54	-7.85	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

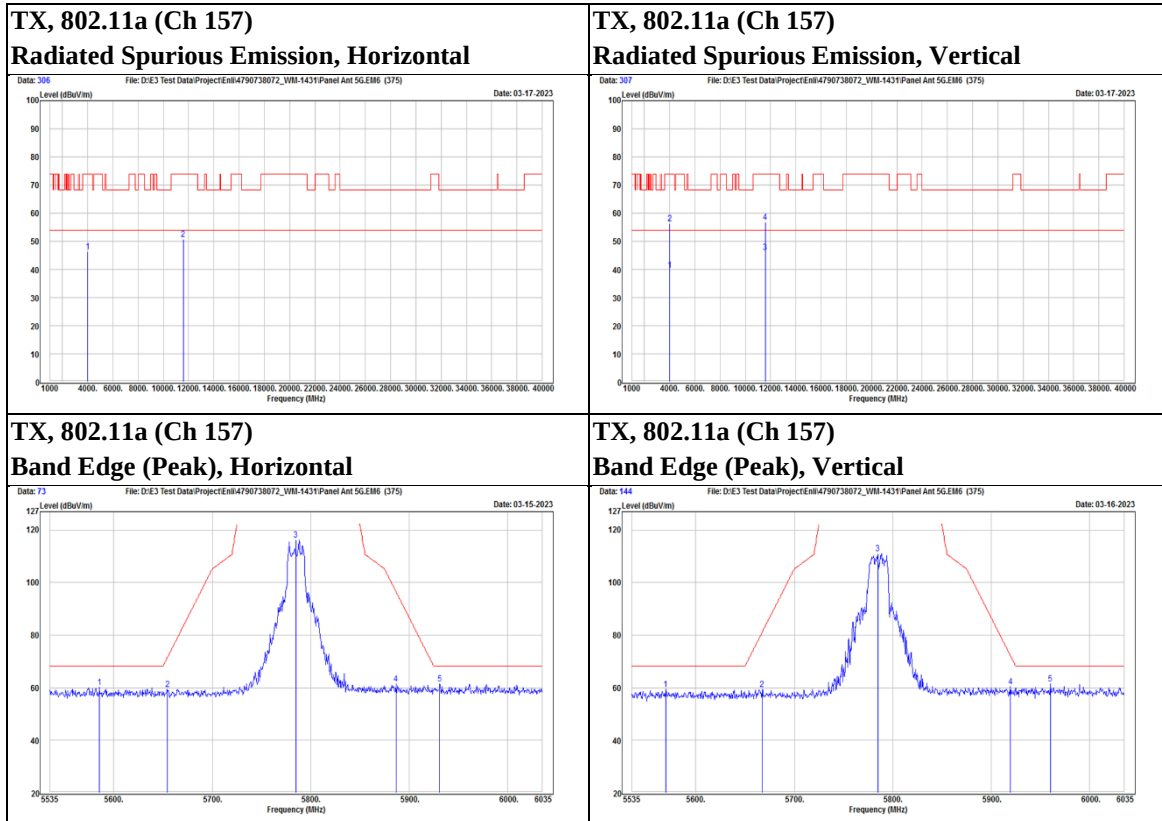


Mode	802.11a	Channel	165
------	---------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	*	3992	45.48	0.05	45.53	74	-28.47	PK
	@	5825	93.2	20.57	113.77	N/A	N/A	PK
		5899	40.75	20.7	61.45	87.4	-25.95	PK
		6035	40.96	20.92	61.88	68.2	-6.32	PK
	*	11650	32.81	18.38	51.19	74	-22.81	PK
Vertical		3992	56.19	0.05	56.24	74	-17.76	PK
		3992	39.58	0.05	39.63	54	-14.37	AVG
	@	5825	91.02	20.57	111.59	N/A	N/A	PK
		5879	40.22	20.68	60.9	102.23	-41.33	PK
		6008.5	40.35	20.83	61.18	68.2	-7.02	PK
		11650	37.73	18.38	56.11	74	-17.89	PK
		11650	27.15	18.38	45.53	54	-8.47	AVG


TX, 802.11a (Ch 165)
Radiated Spurious Emission, Horizontal

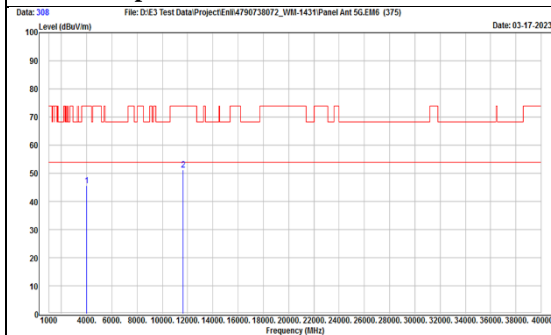


TX, 802.11a (Ch 165)
Radiated Spurious Emission, Vertical

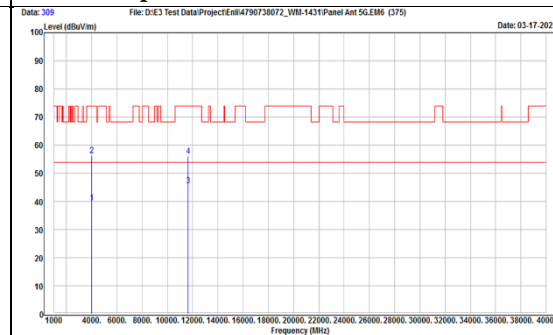

TX, 802.11a (Ch 165)
Band Edge (Peak), Horizontal

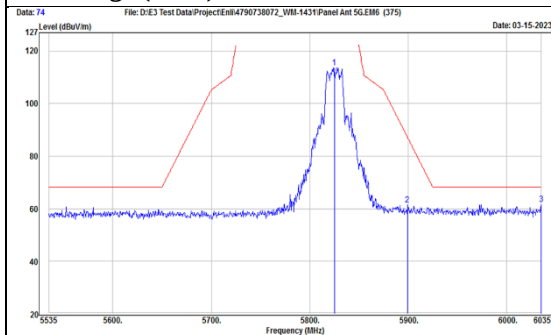

TX, 802.11a (Ch 165)
Band Edge (Peak), Vertical

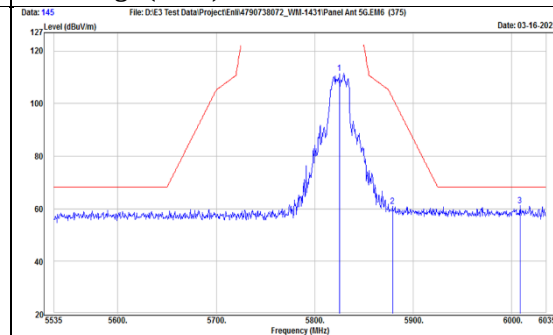

Mode	802.11ax(HE20)	Channel	36
------	----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2037	49.18	-6.01	43.17	68.2	-25.03	PK
	*	3992	45.93	0.05	45.98	74	-28.02	PK
		5145.6	42.86	19.22	62.08	74	-11.92	PK
		5149.1	32.63	19.22	51.85	54	-2.15	AVG
	@	5180	95.65	19.14	114.79	N/A	N/A	PK
	@	5180	85.49	19.14	104.63	N/A	N/A	AVG
	*	10360	30.48	17.03	47.51	68.2	-20.69	PK
Vertical		2003	50.86	-6.21	44.65	68.2	-23.55	PK
		3992	55.03	0.05	55.08	74	-18.92	PK
		3992	36.94	0.05	36.99	54	-17.01	AVG
		5129.15	42.42	19.24	61.66	74	-12.34	PK
		5149.1	29.84	19.22	49.06	54	-4.94	AVG
	@	5180	85.08	19.14	104.22	N/A	N/A	PK
	@	5180	77.58	19.14	96.72	N/A	N/A	AVG
	*	10360	31.45	17.03	48.48	68.2	-19.72	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

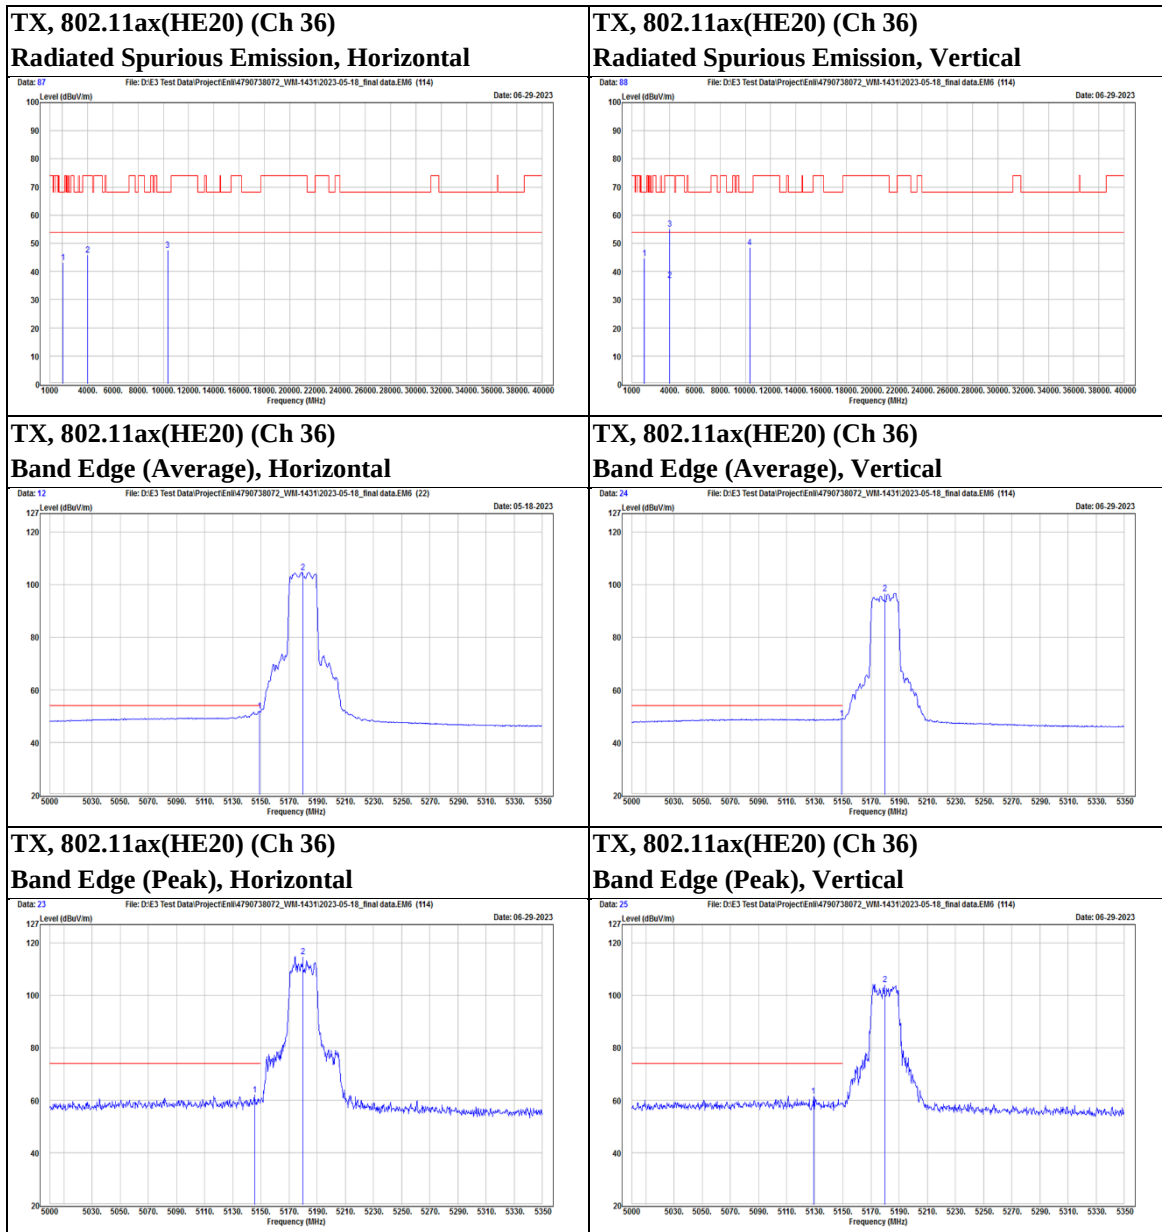

Mode	802.11ax(HE20)	Channel	44
------	----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	*	3992	42.87	0.05	42.92	74	-31.08	PK
		5145.95	42.79	19.22	62.01	74	-11.99	PK
		5148.4	32.07	19.22	51.29	54	-2.71	AVG
	@	5220	95.26	19.04	114.3	N/A	N/A	PK
	@	5220	86.87	19.04	105.91	N/A	N/A	AVG
	*	10440	30.94	17.45	48.39	68.2	-19.81	PK
Vertical		3992	55.24	0.05	55.29	74	-18.71	PK
		3992	38.68	0.05	38.73	54	-15.27	AVG
		5120.4	42.26	19.24	61.5	74	-12.5	PK
		5136.5	29.56	19.23	48.79	54	-5.21	AVG
	@	5220	90.3	19.04	109.34	N/A	N/A	PK
	@	5220	81.8	19.04	100.84	N/A	N/A	AVG
	*	10440	30.89	17.45	48.34	68.2	-19.86	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1