




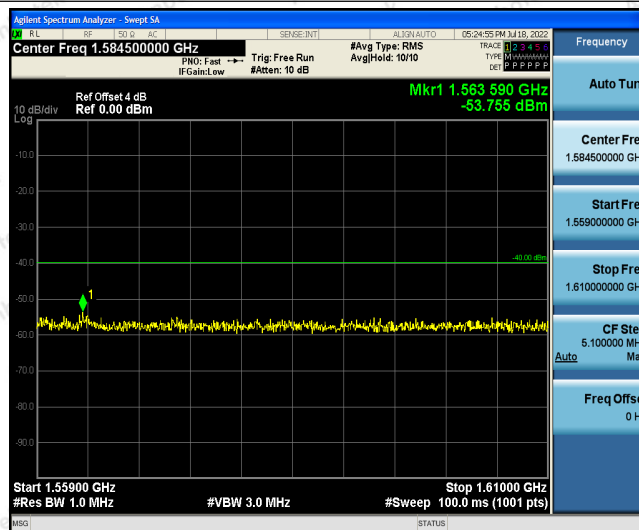


Band13-10MHz-16QAM-23230-1RB#0-Range1:30~1000MHz

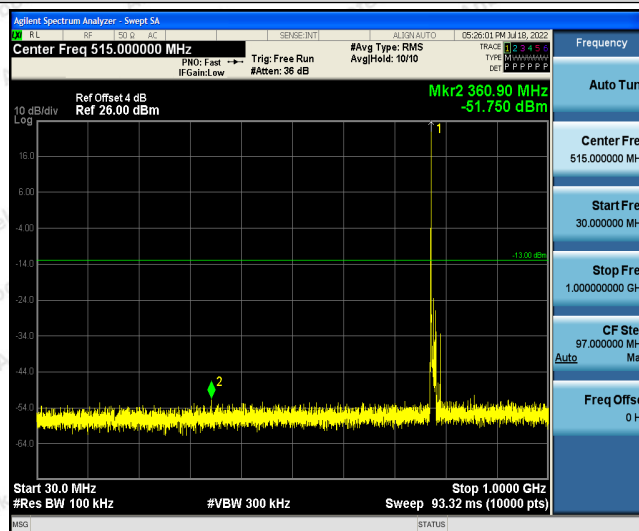


Band13-10MHz-16QAM-23230-1RB#0-Range3:763~775MHz

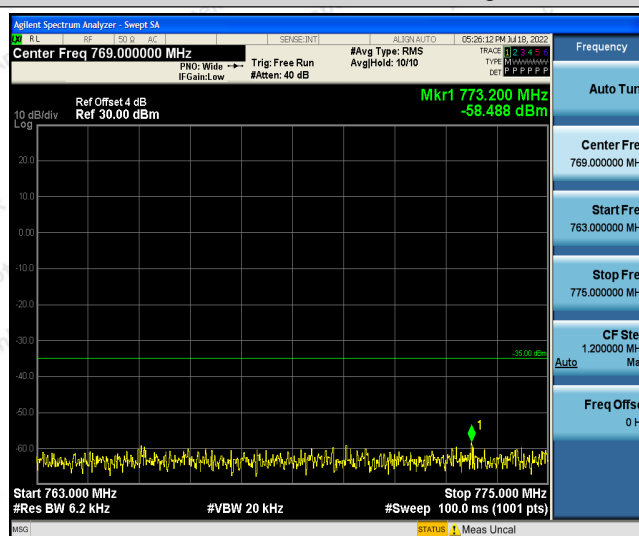


Band13-10MHz-16QAM-23230-1RB#0-Range4:793~805MHz

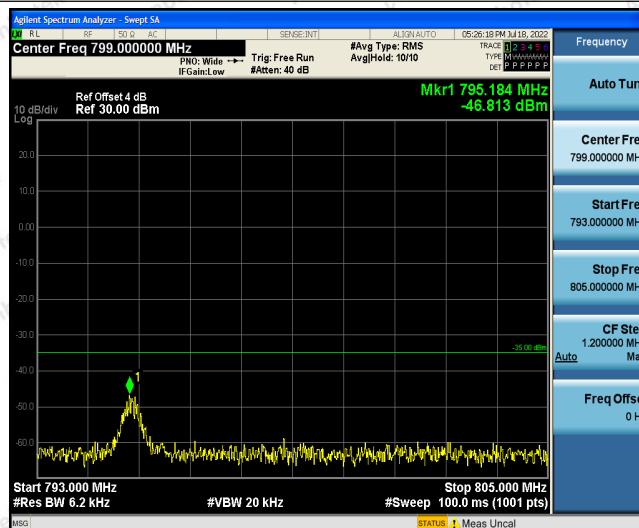


Band13-10MHz-16QAM-23230-1RB#0-Range2:1000~10000MHz

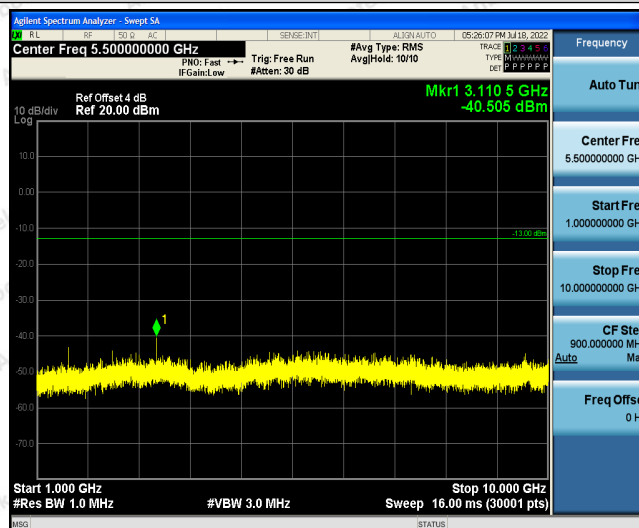


Band13-10MHz-16QAM-23230-1RB#0-Range5:1559~1610MHz

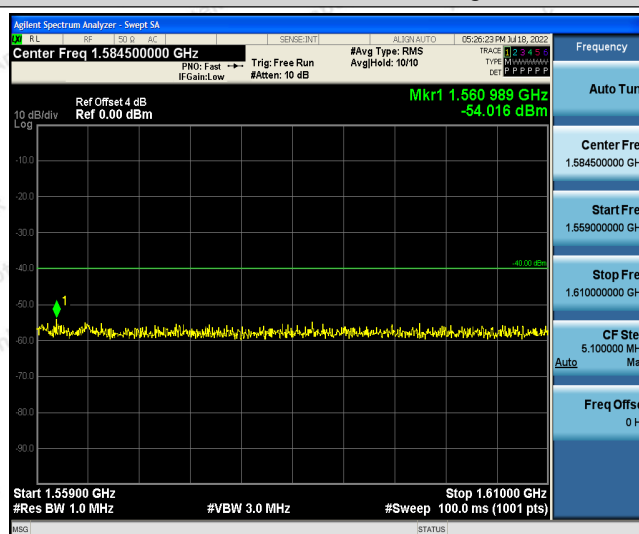


Band25-1.4MHz-QPSK-26047-1RB#0-Range1:30~1000MHz

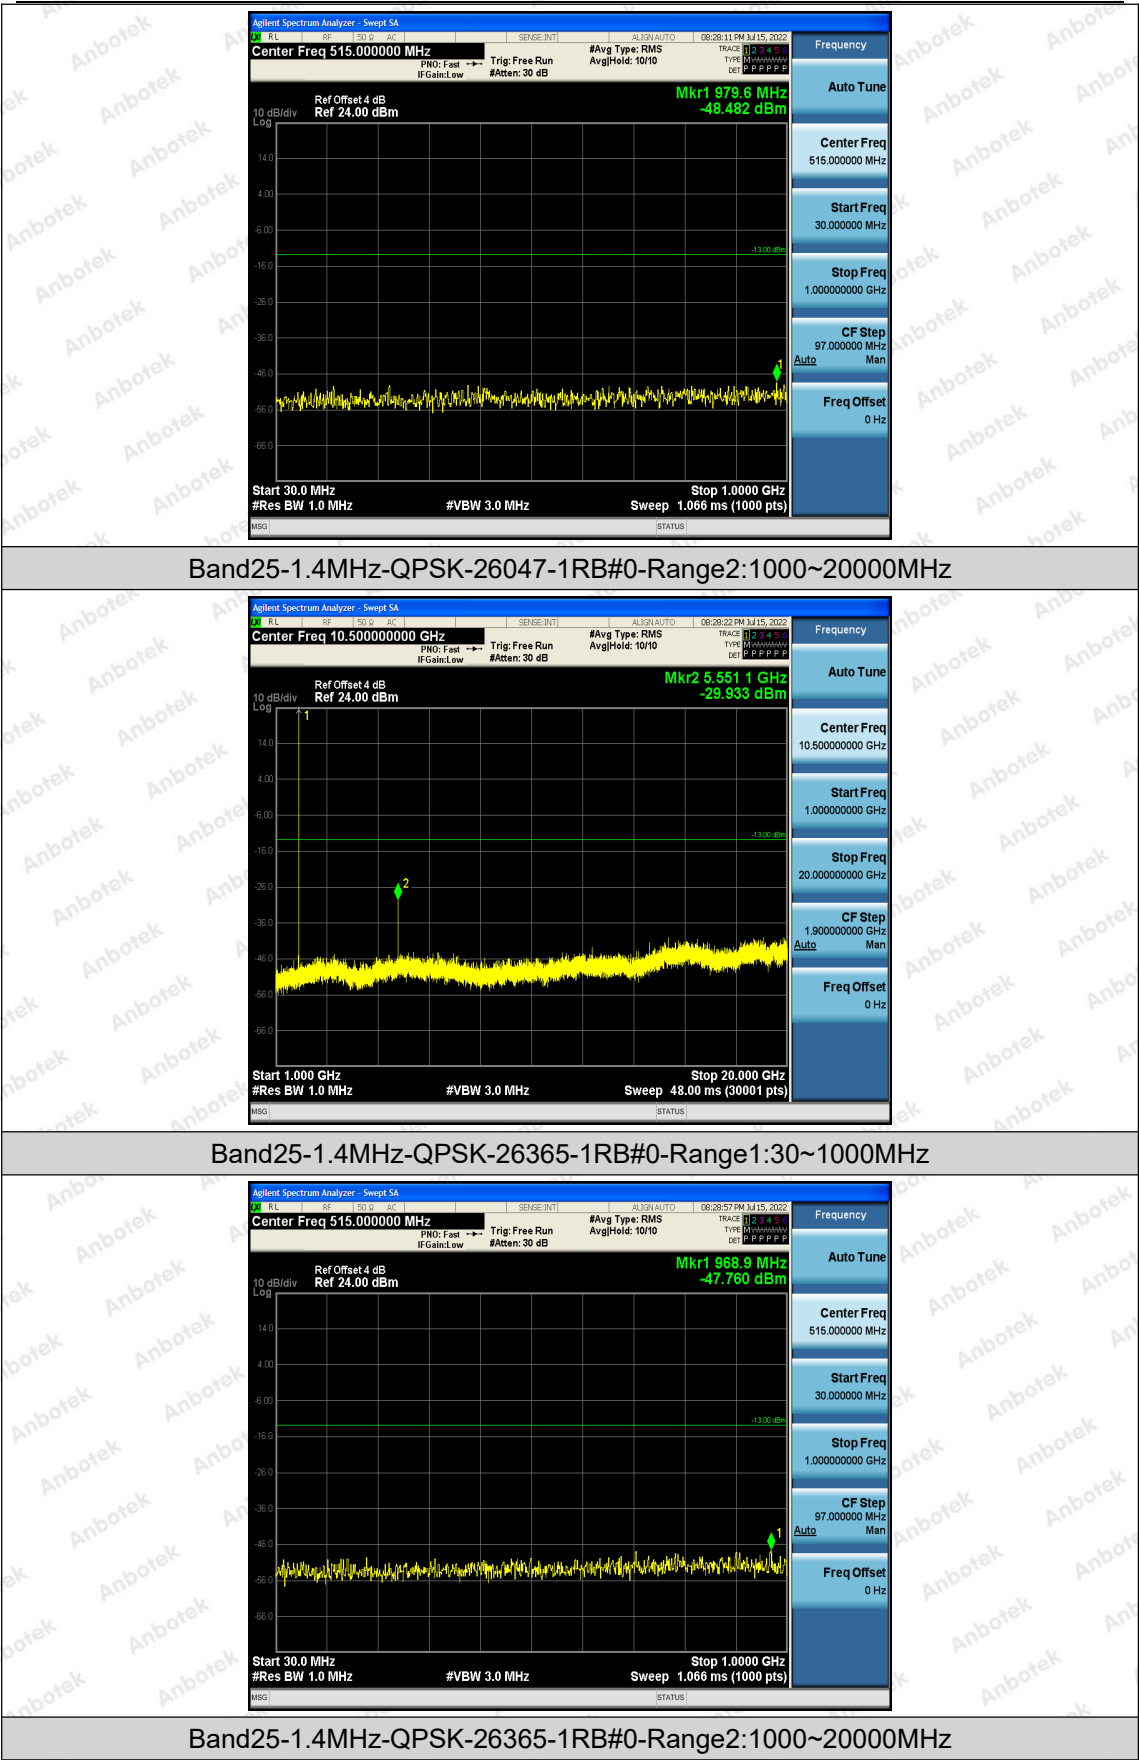


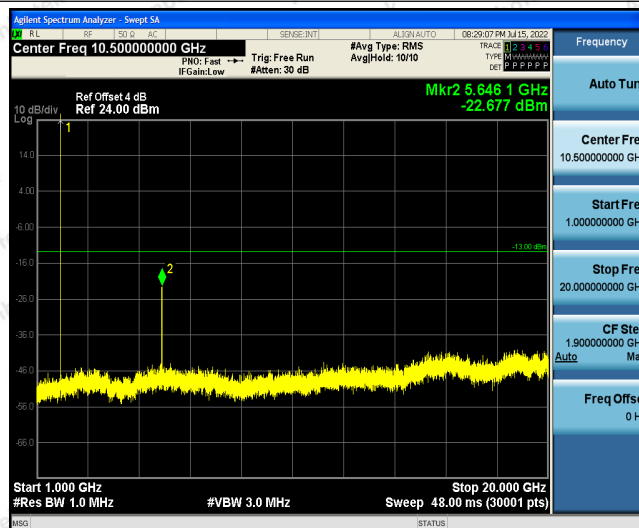


Band25-1.4MHz-QPSK-26683-1RB#0-Range1:30~1000MHz

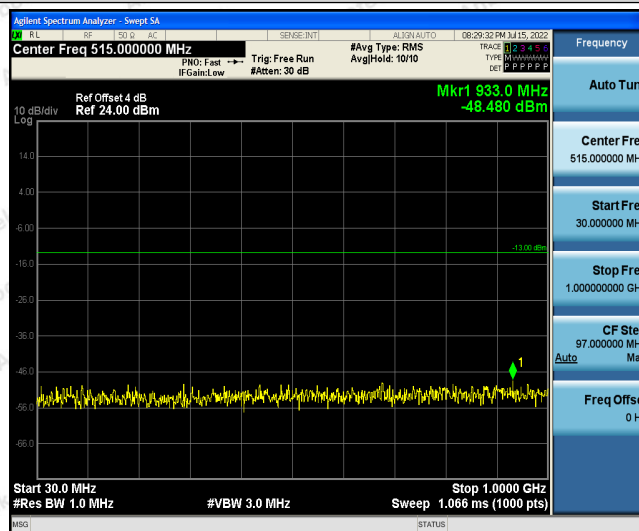


Band25-1.4MHz-QPSK-26683-1RB#0-Range2:1000~20000MHz

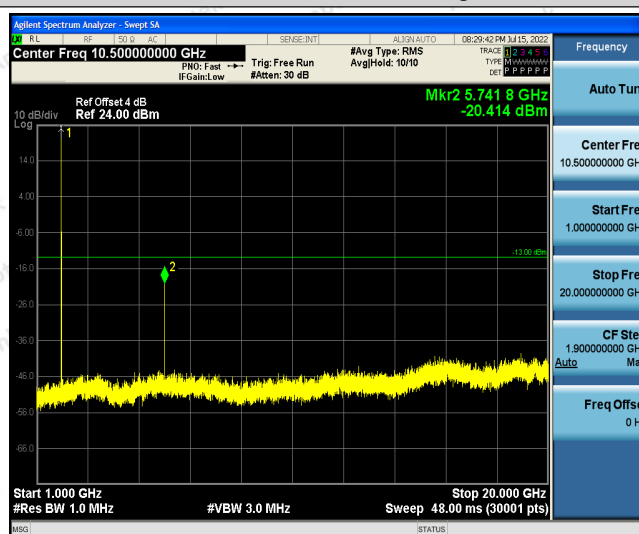


Band25-1.4MHz-16QAM-26047-1RB#0-Range1:30~1000MHz

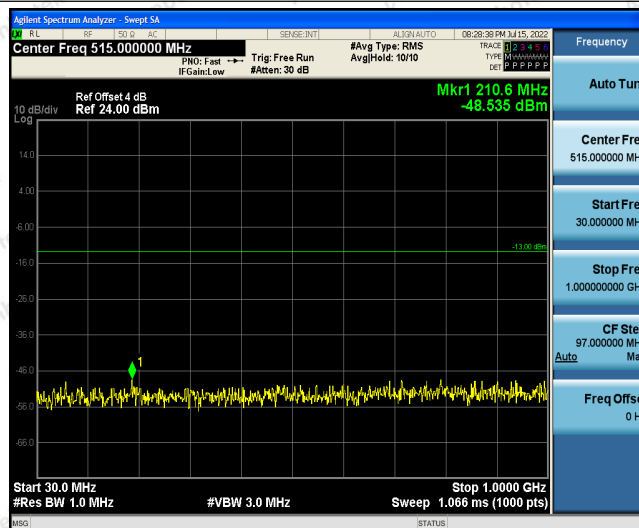

Band25-1.4MHz-16QAM-26047-1RB#0-Range2:1000~20000MHz

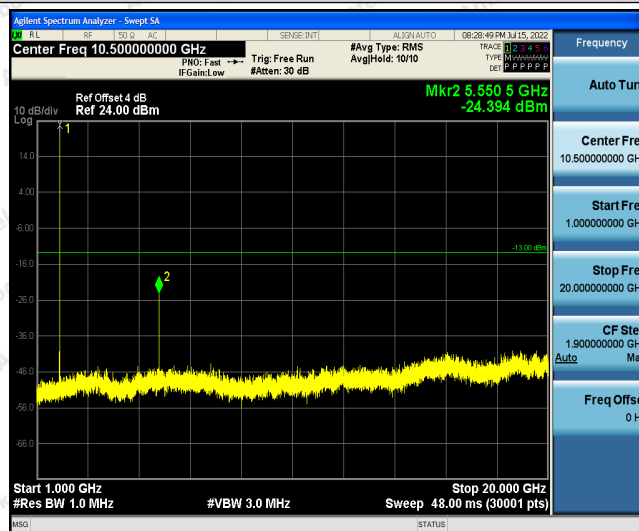

Band25-1.4MHz-16QAM-26365-1RB#0-Range1:30~1000MHz

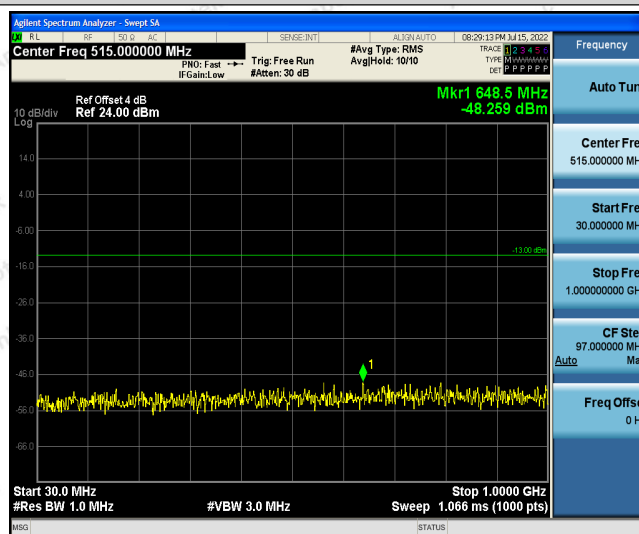

Band25-1.4MHz-16QAM-26365-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

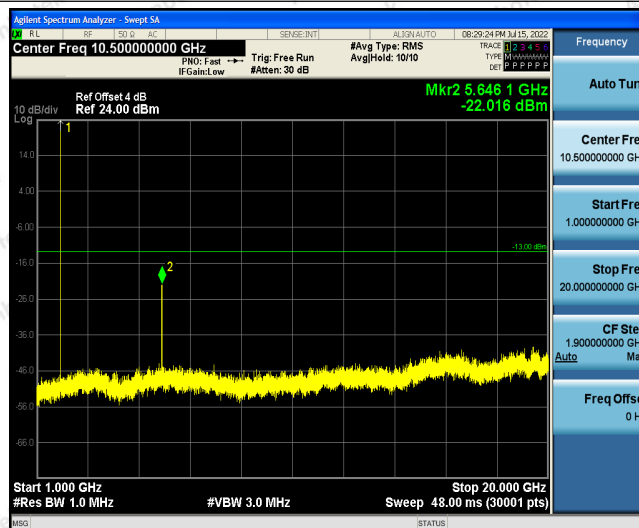


Band25-1.4MHz-16QAM-26683-1RB#0-Range1:30~1000MHz

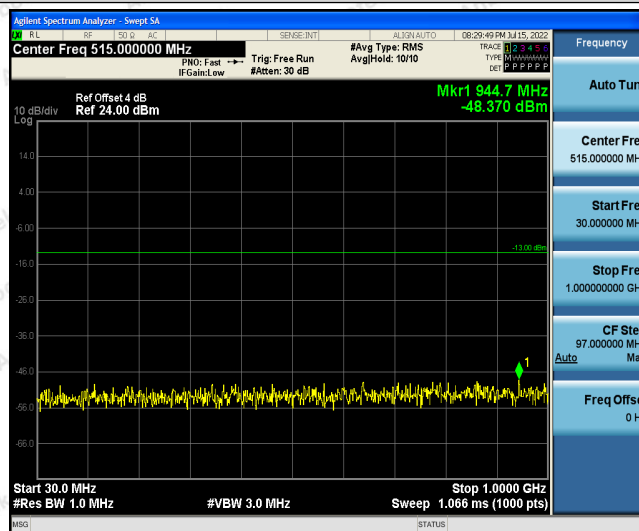


Band25-1.4MHz-16QAM-26683-1RB#0-Range2:1000~20000MHz

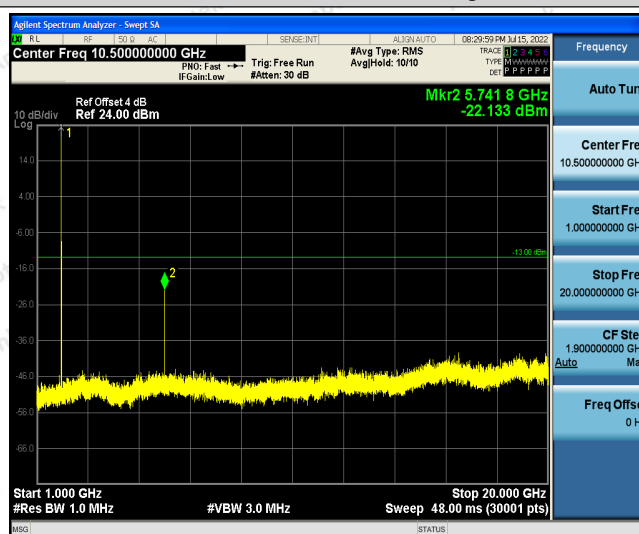


Band25-3MHz-QPSK-26055-1RB#0-Range1:30~1000MHz

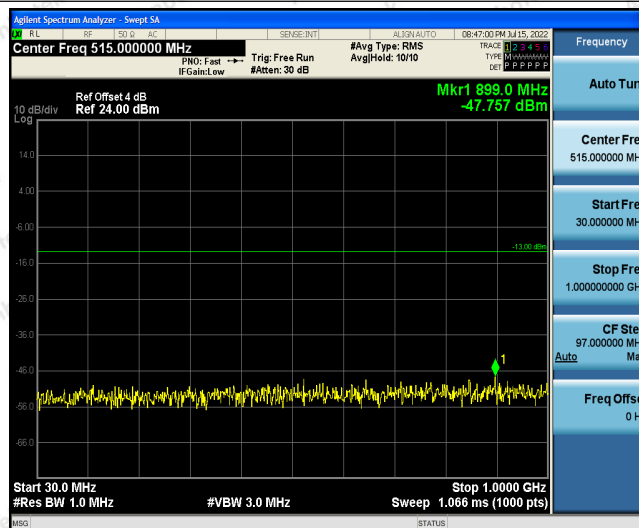


Band25-3MHz-QPSK-26055-1RB#0-Range2:1000~20000MHz

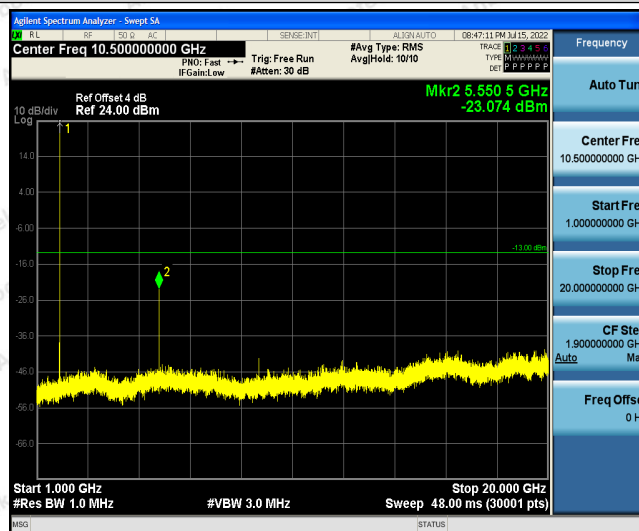


Band25-3MHz-QPSK-26365-1RB#0-Range1:30~1000MHz

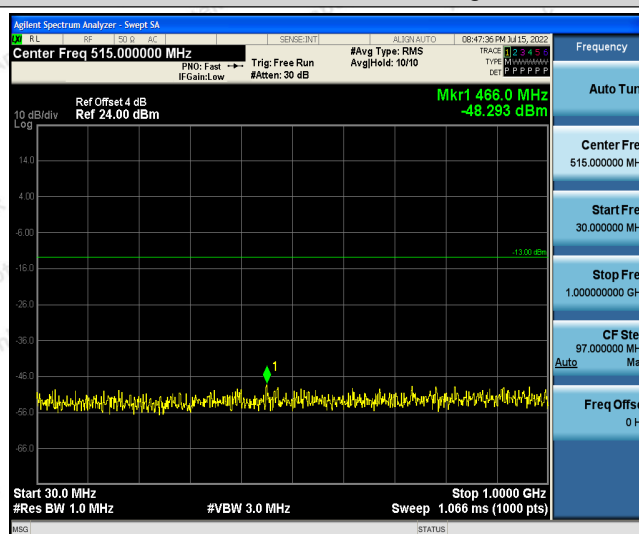


Band25-3MHz-QPSK-26365-1RB#0-Range2:1000~20000MHz

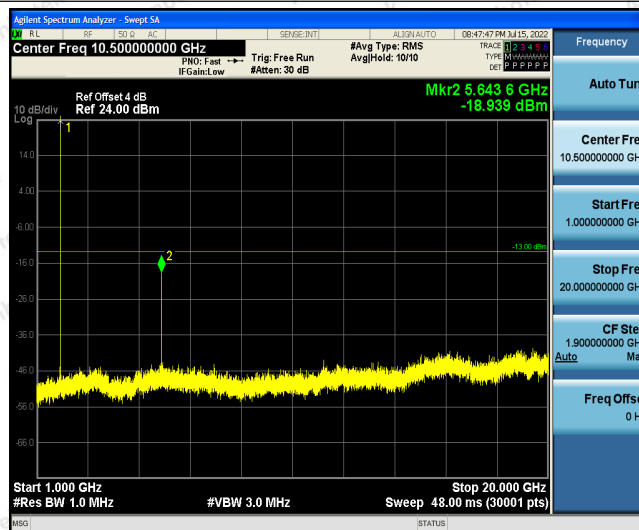


Band25-3MHz-QPSK-26675-1RB#0-Range1:30~1000MHz

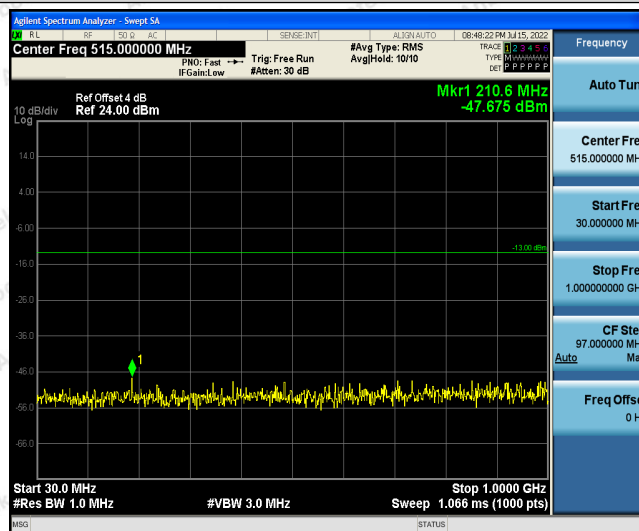


Band25-3MHz-QPSK-26675-1RB#0-Range2:1000~20000MHz

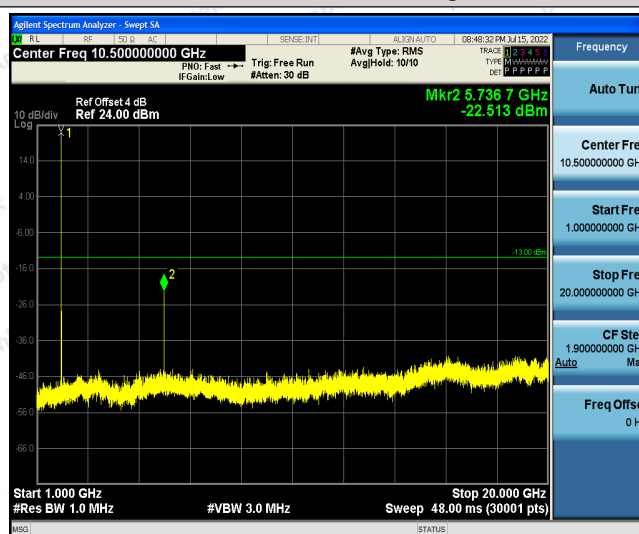


Band25-3MHz-16QAM-26055-1RB#0-Range1:30~1000MHz

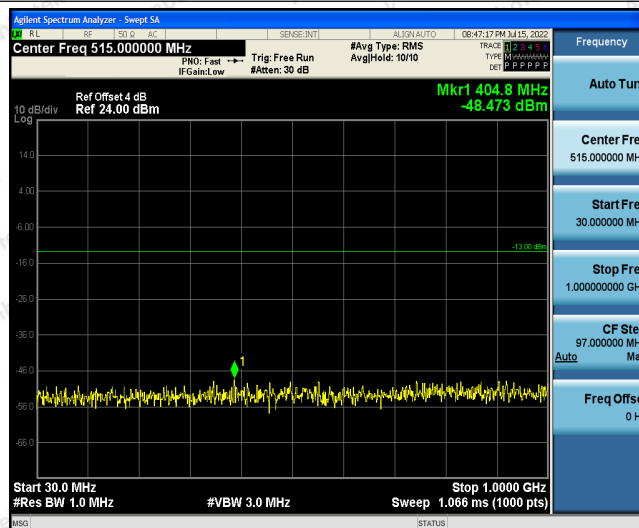


Band25-3MHz-16QAM-26055-1RB#0-Range2:1000~20000MHz

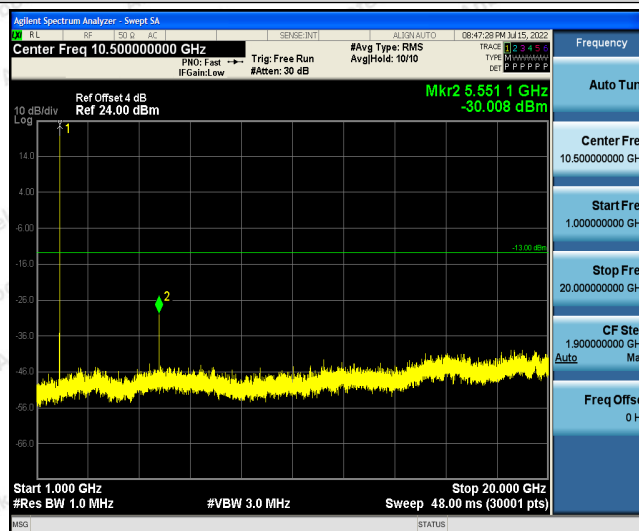


Band25-3MHz-16QAM-26365-1RB#0-Range1:30~1000MHz

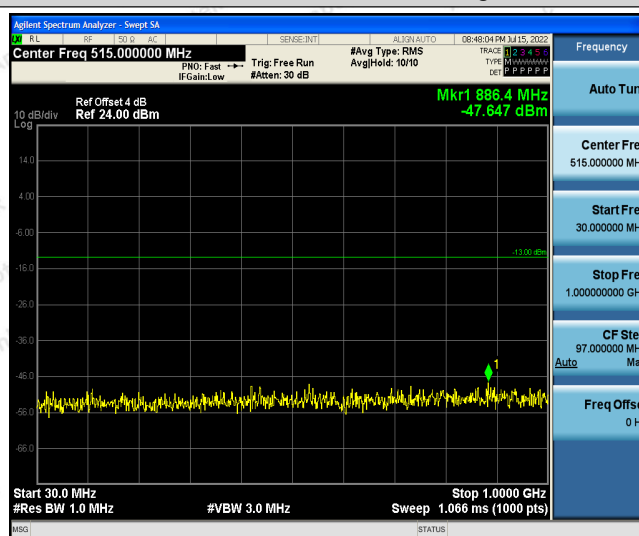


Band25-3MHz-16QAM-26365-1RB#0-Range2:1000~20000MHz

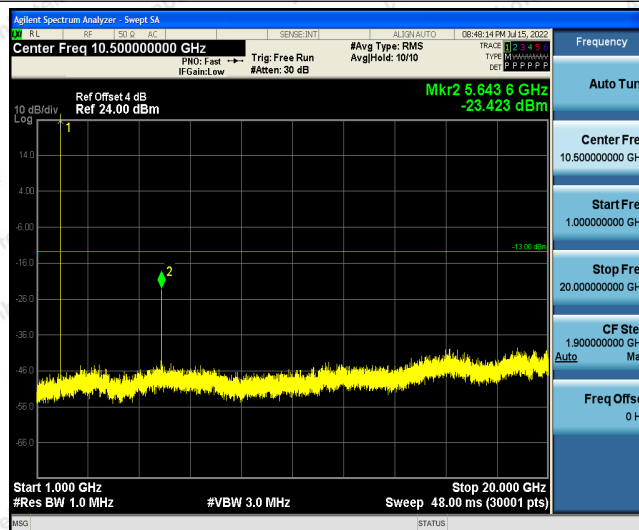


Band25-3MHz-16QAM-26675-1RB#0-Range1:30~1000MHz

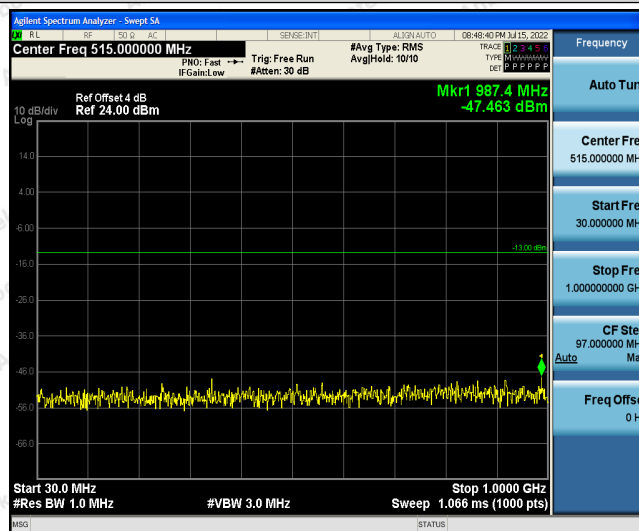


Band25-3MHz-16QAM-26675-1RB#0-Range2:1000~20000MHz

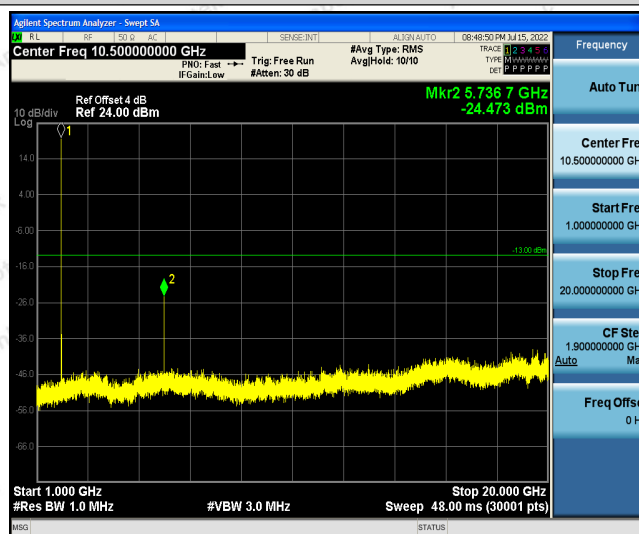


Band25-5MHz-QPSK-26065-1RB#0-Range1:30~1000MHz

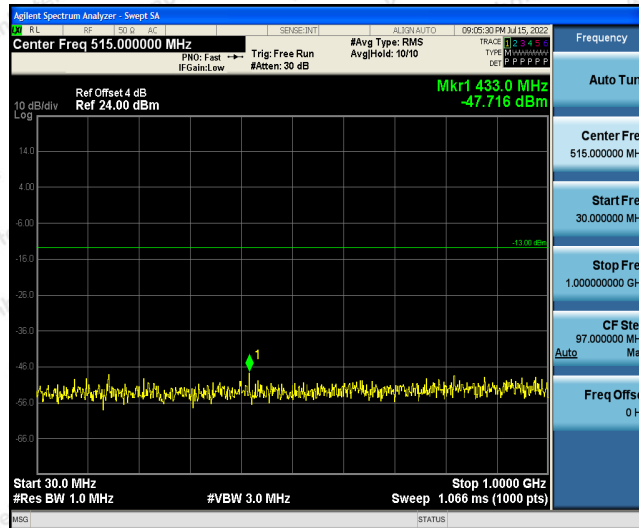


Band25-5MHz-QPSK-26065-1RB#0-Range2:1000~20000MHz

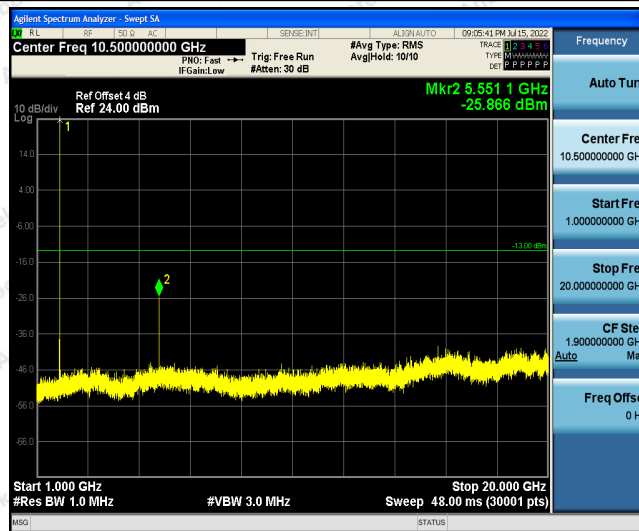


Band25-5MHz-QPSK-26365-1RB#0-Range1:30~1000MHz

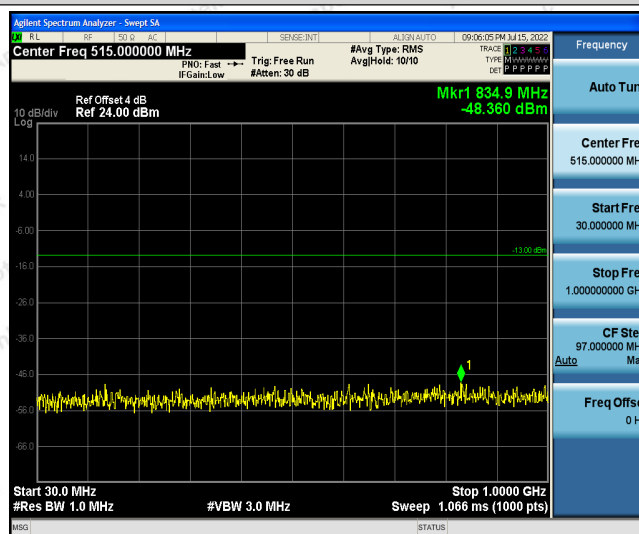


Band25-5MHz-QPSK-26365-1RB#0-Range2:1000~20000MHz

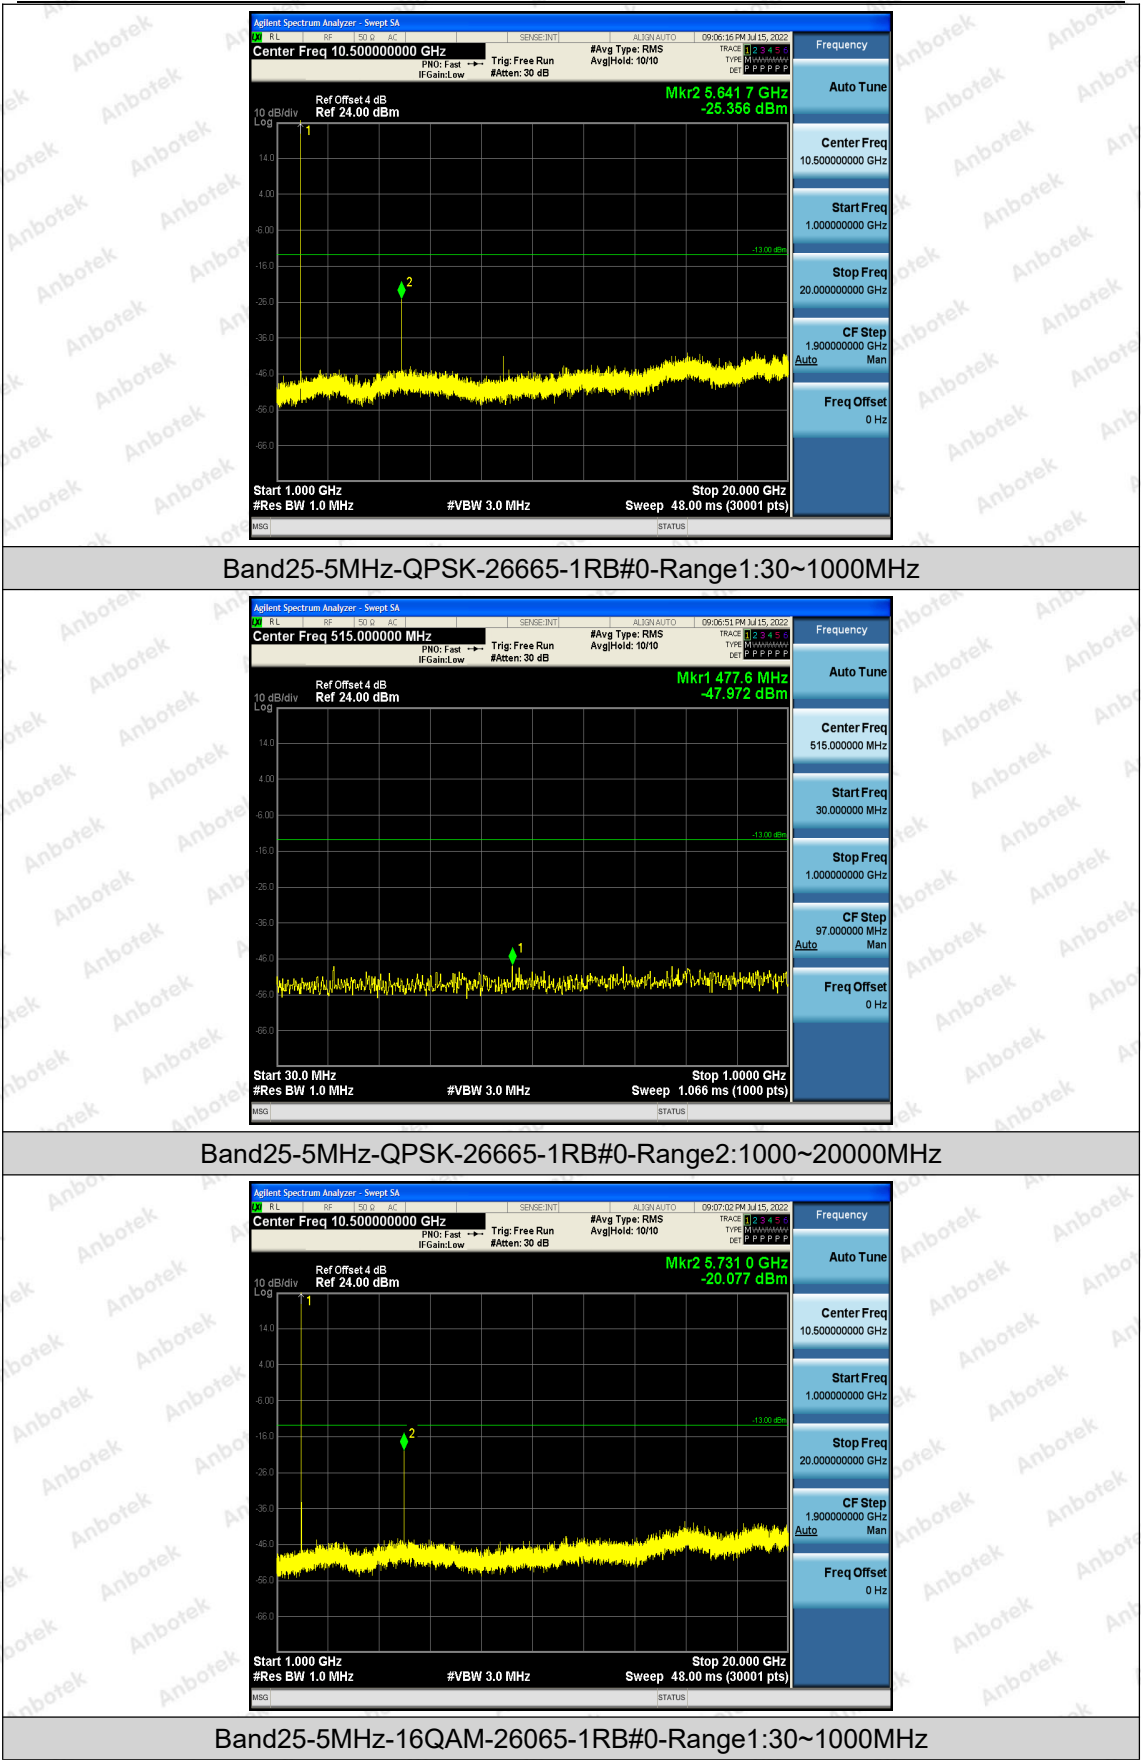


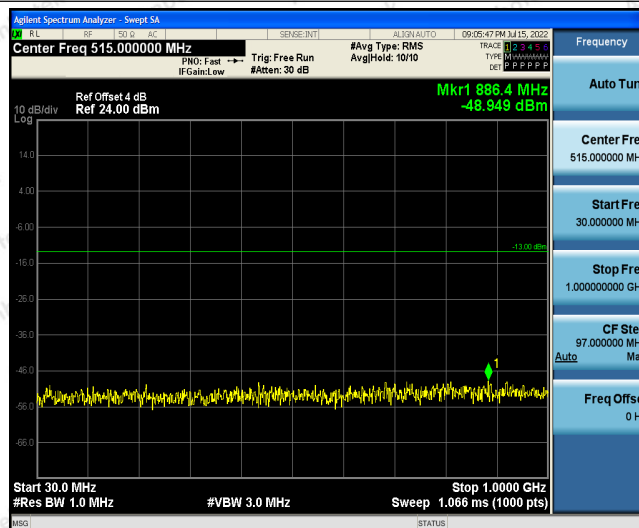


Band25-5MHz-16QAM-26065-1RB#0-Range2:1000~20000MHz

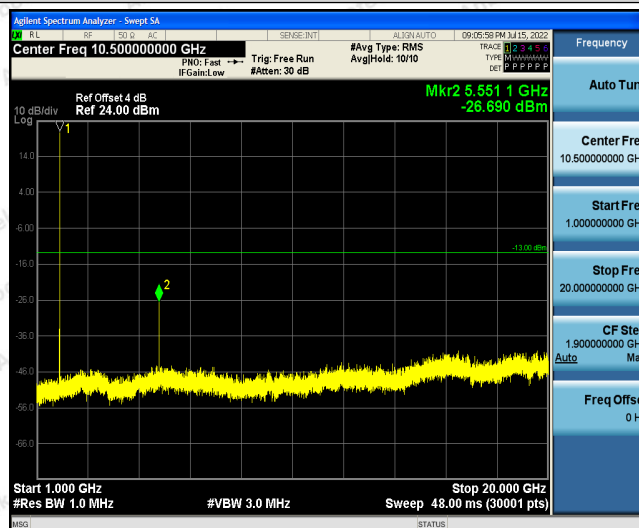


Band25-5MHz-16QAM-26365-1RB#0-Range1:30~1000MHz

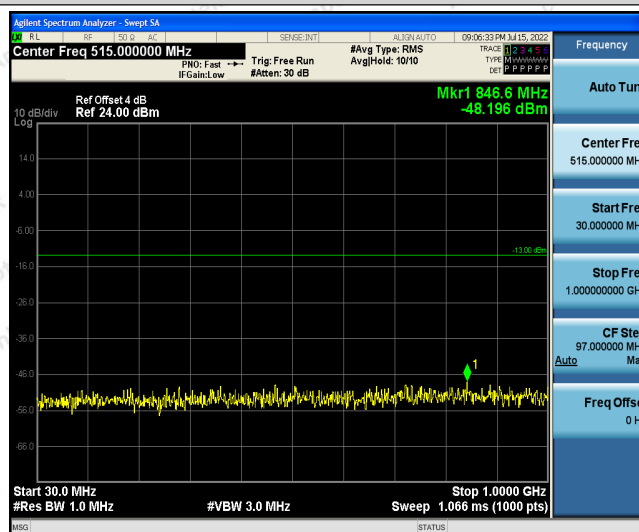


Band25-5MHz-16QAM-26365-1RB#0-Range2:1000~20000MHz

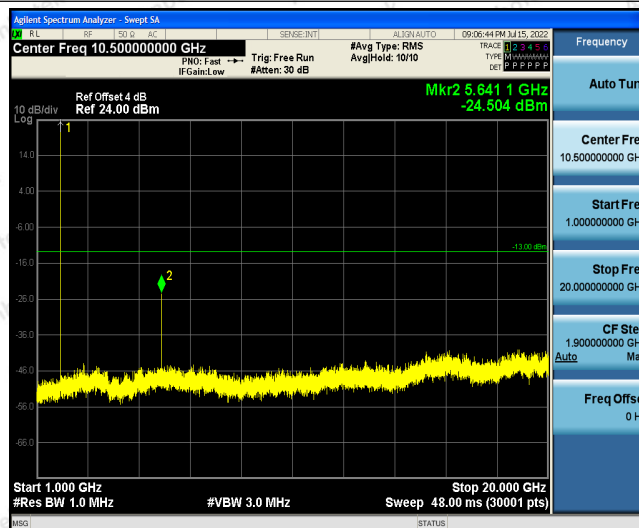


Band25-5MHz-16QAM-26665-1RB#0-Range1:30~1000MHz

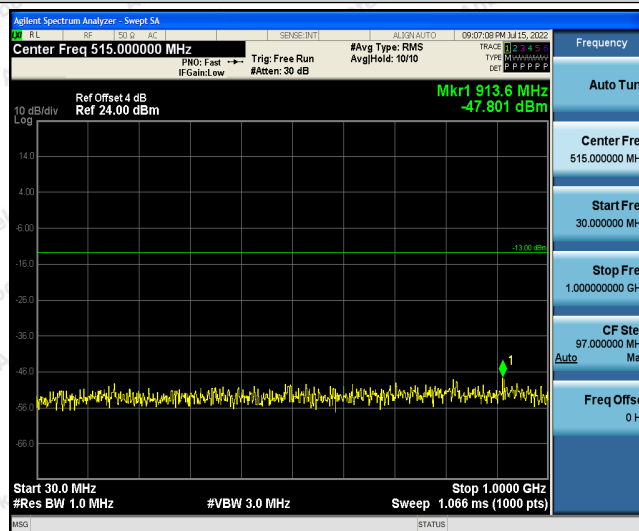


Band25-5MHz-16QAM-26665-1RB#0-Range2:1000~20000MHz

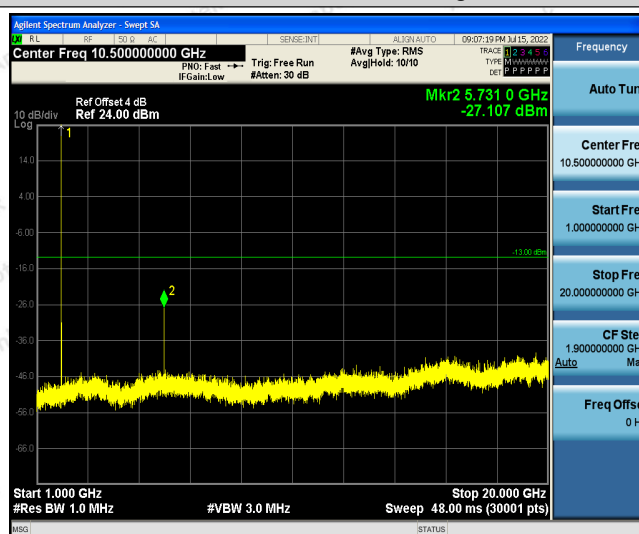


Band25-10MHz-QPSK-26090-1RB#0-Range1:30~1000MHz

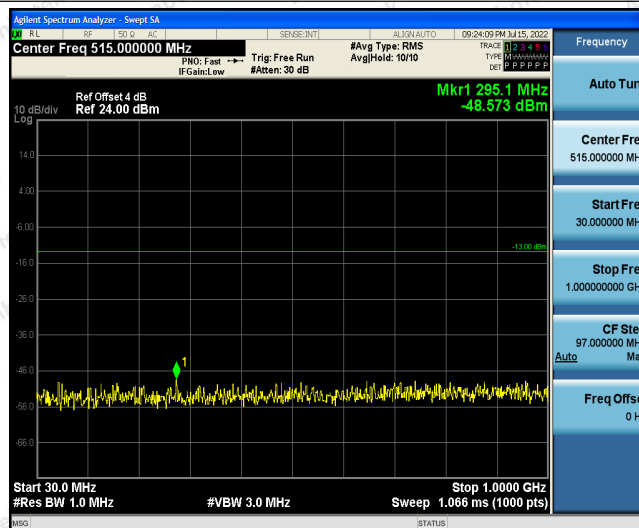


Band25-10MHz-QPSK-26090-1RB#0-Range2: 1000~20000MHz

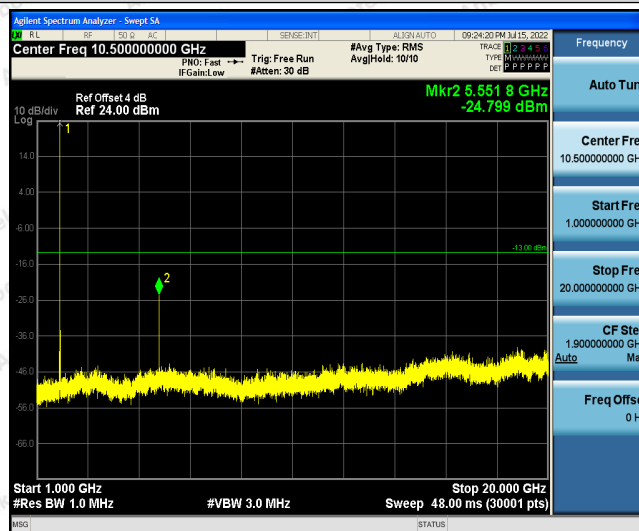


Band25-10MHz-QPSK-26365-1RB#0-Range1:30~1000MHz

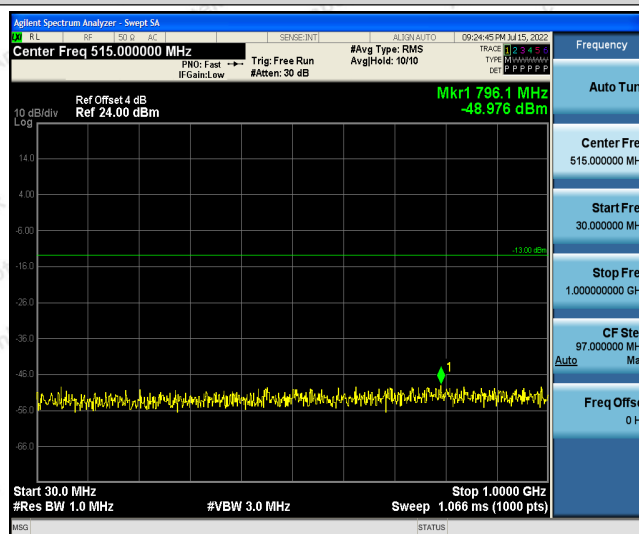


Band25-10MHz-QPSK-26365-1RB#0-Range2: 1000~20000MHz

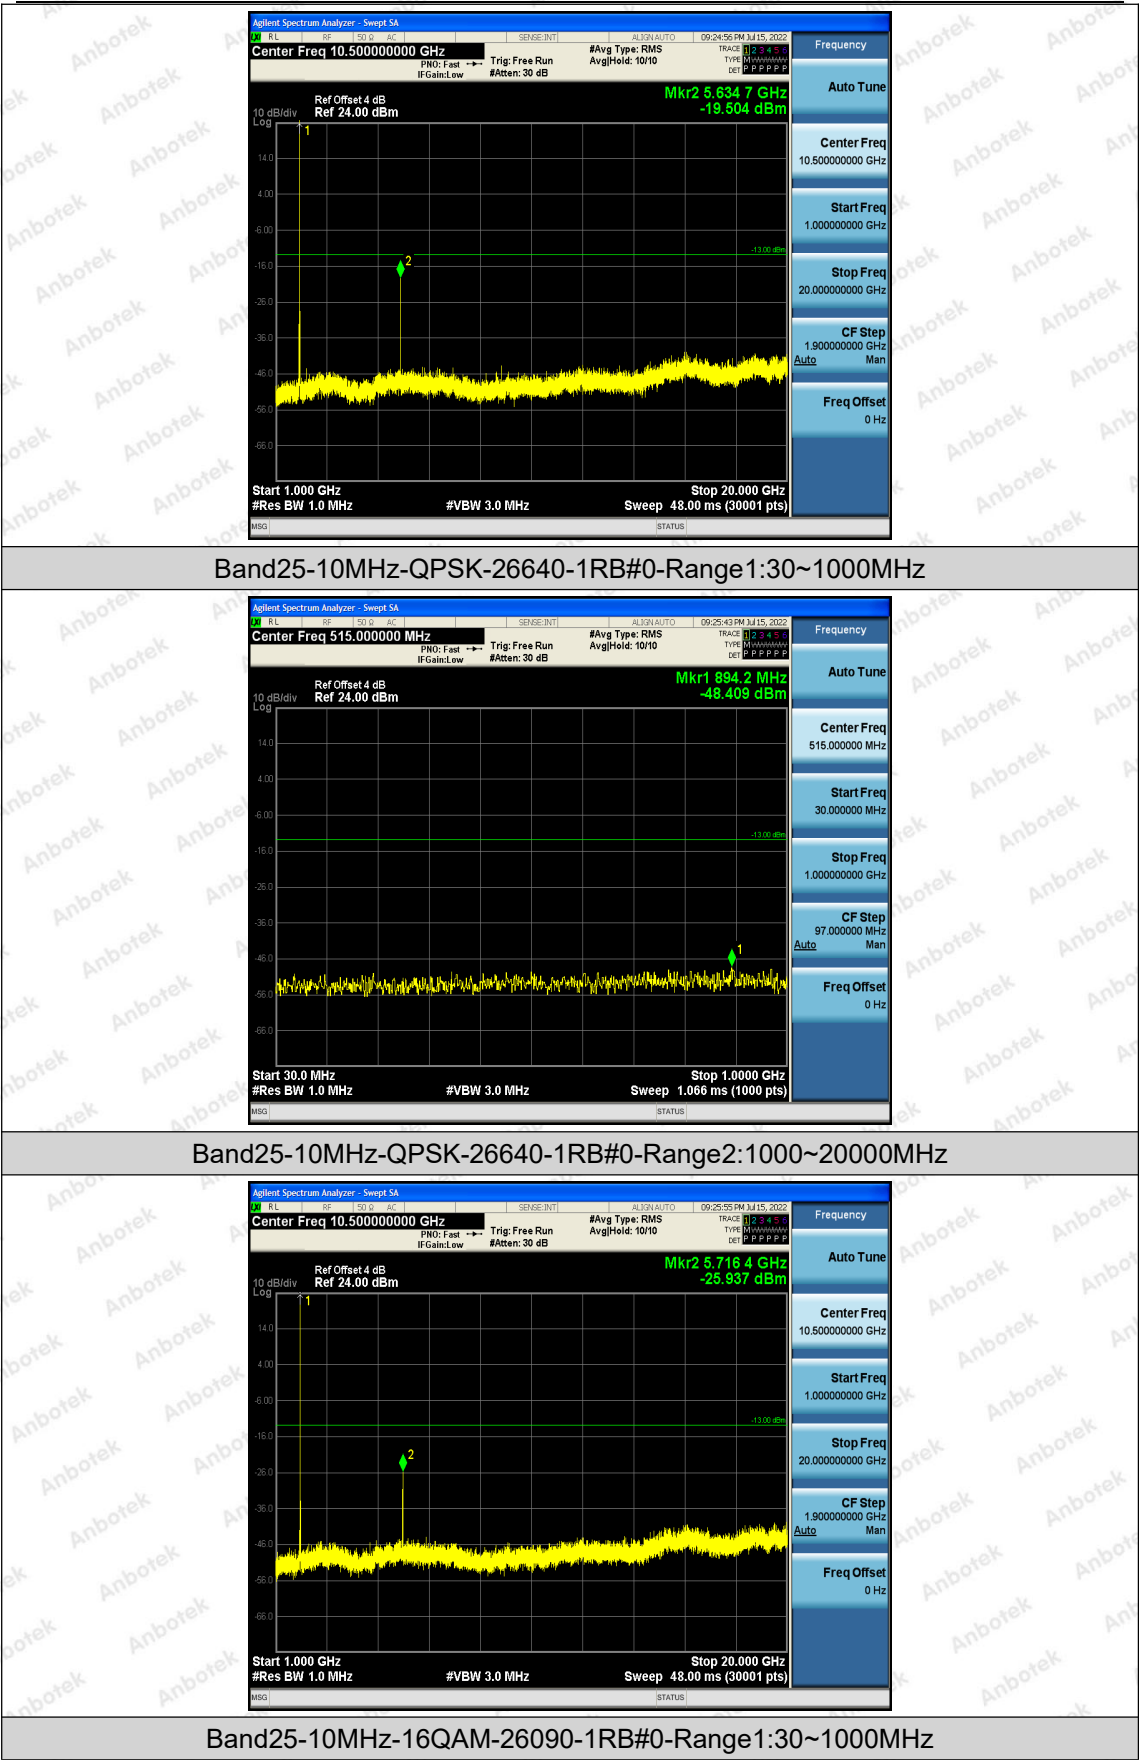


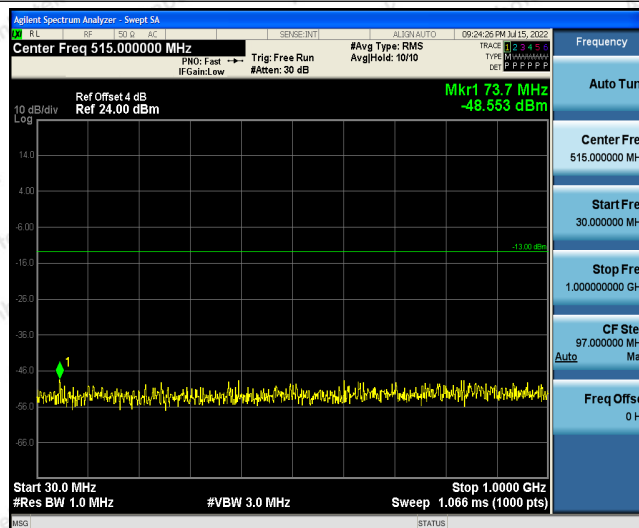


Band25-10MHz-16QAM-26090-1RB#0-Range2:1000~20000MHz

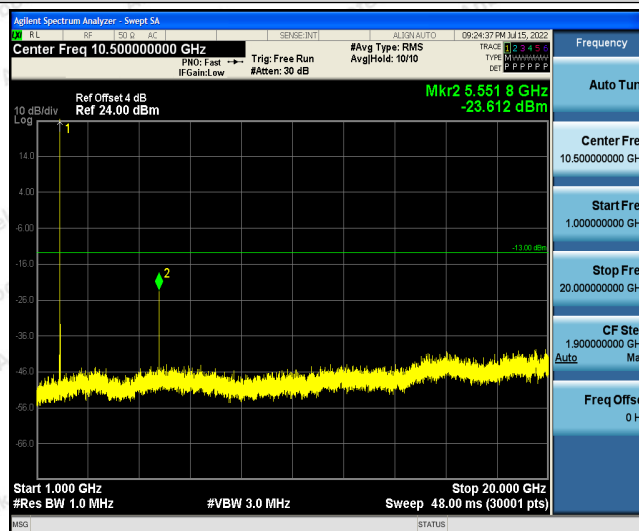


Band25-10MHz-16QAM-26365-1RB#0-Range1:30~1000MHz

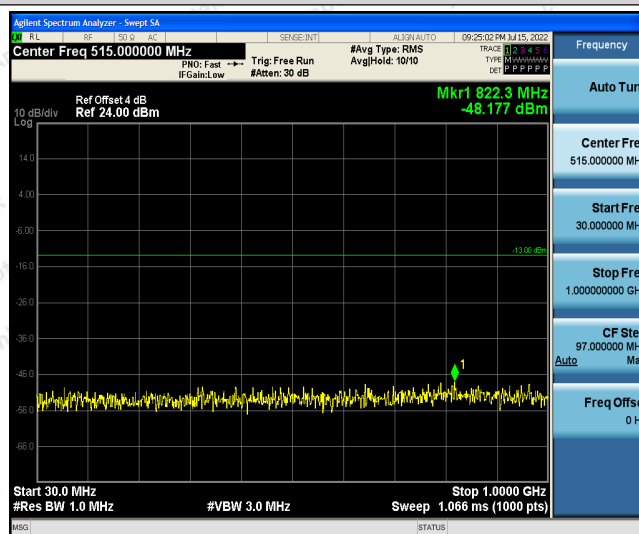


Band25-10MHz-16QAM-26365-1RB#0-Range2:1000~20000MHz

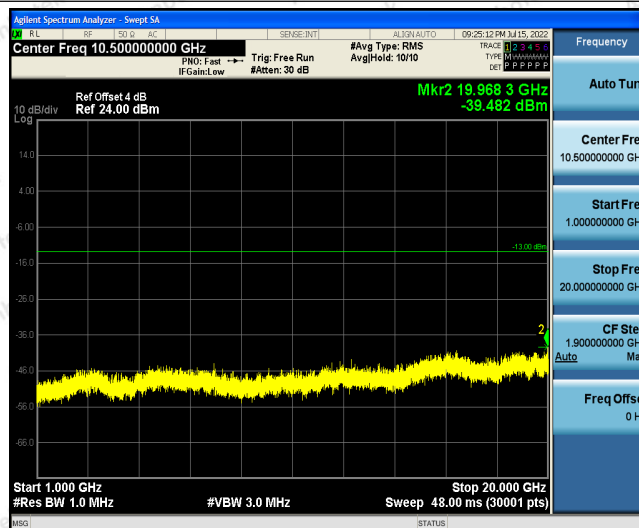


Band25-10MHz-16QAM-26640-1RB#0-Range1:30~1000MHz

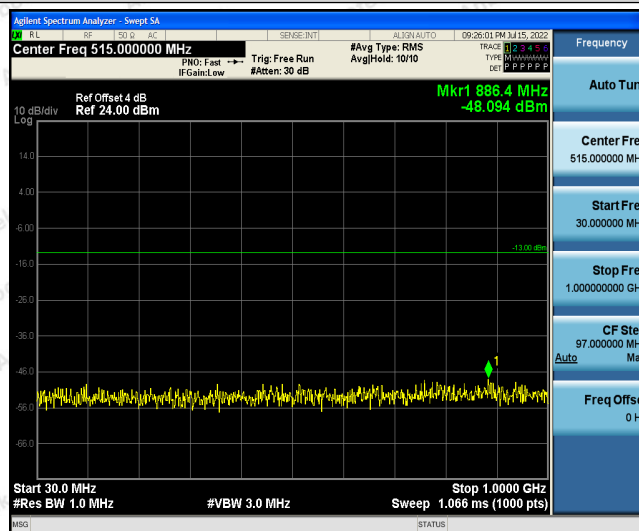


Band25-10MHz-16QAM-26640-1RB#0-Range2:1000~20000MHz

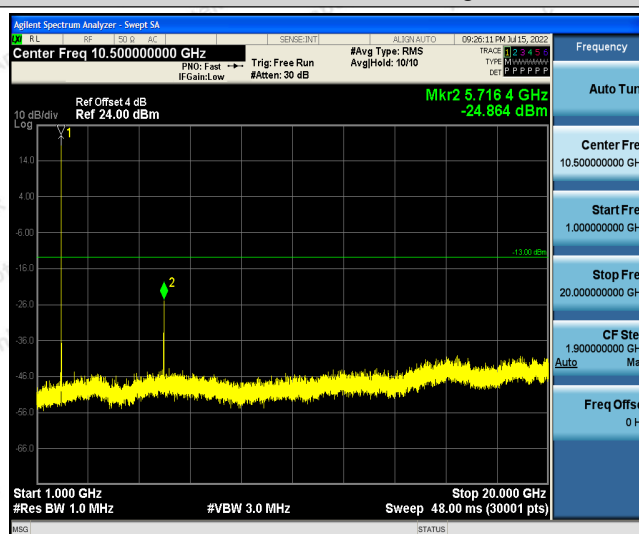


Band25-15MHz-QPSK-26115-1RB#0-Range1:30~1000MHz

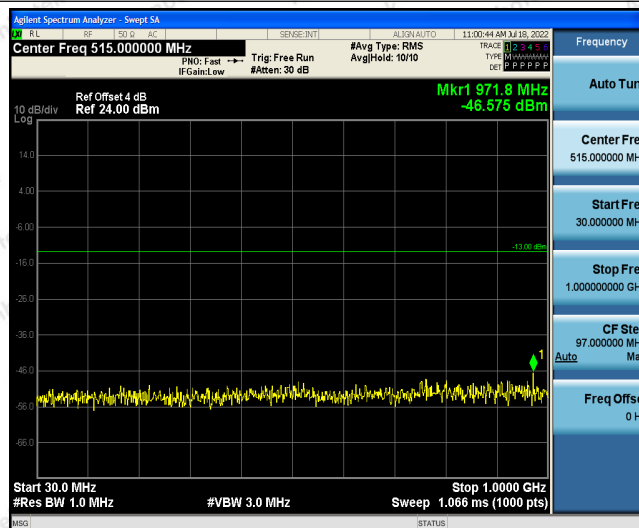


Band25-15MHz-QPSK-26115-1RB#0-Range2:1000~20000MHz

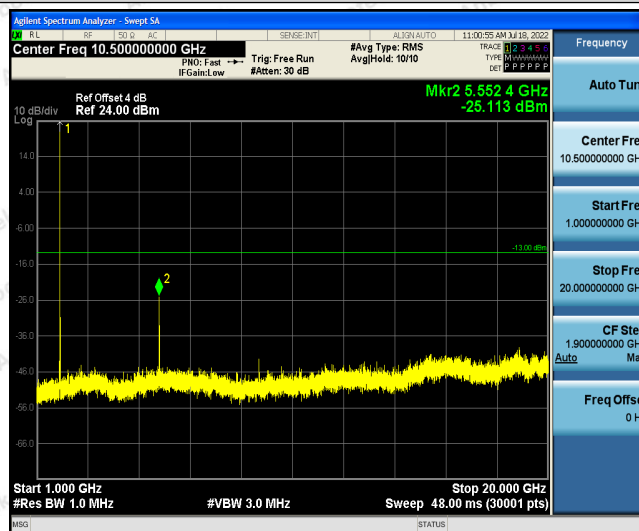


Band25-15MHz-QPSK-26365-1RB#0-Range1:30~1000MHz

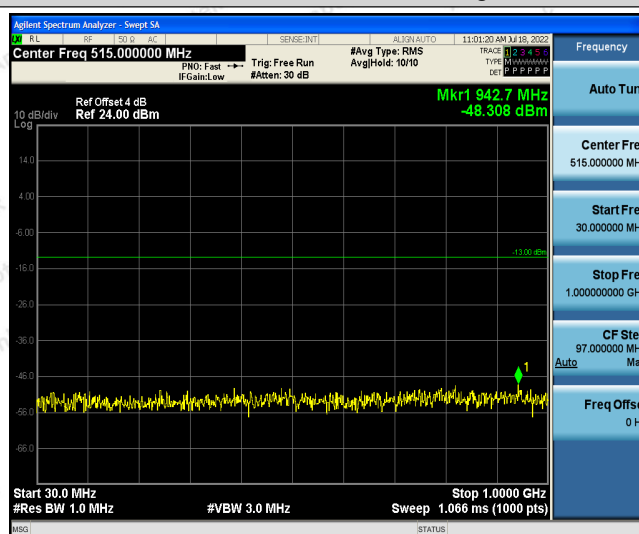


Band25-15MHz-QPSK-26365-1RB#0-Range2:1000~20000MHz

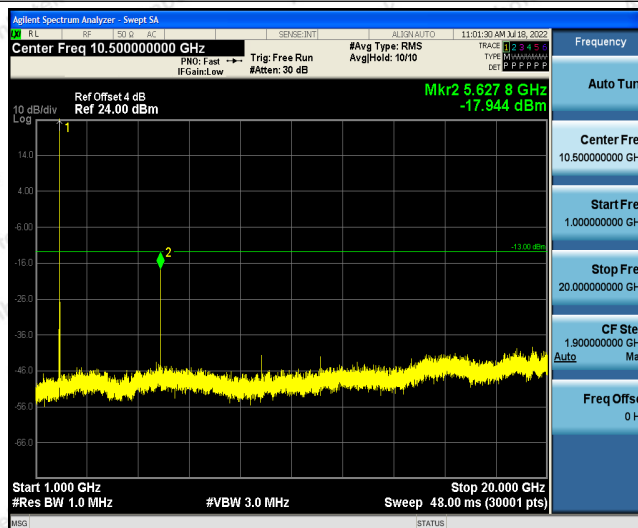


Band25-15MHz-QPSK-26615-1RB#0-Range1:30~1000MHz

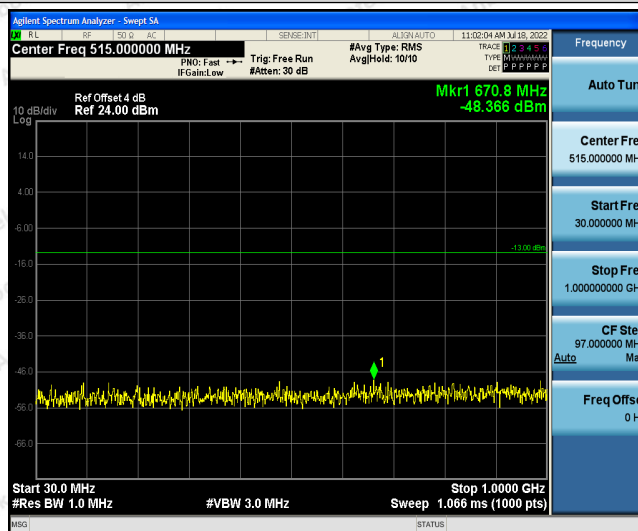


Band25-15MHz-QPSK-26615-1RB#0-Range2:1000~20000MHz

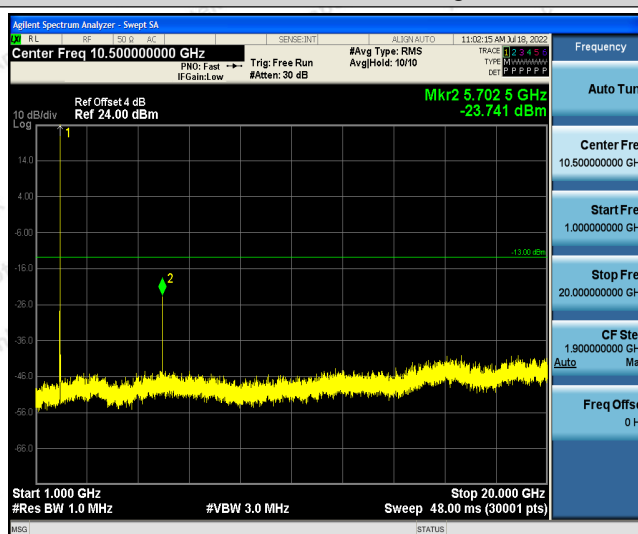


Band25-15MHz-16QAM-26115-1RB#0-Range1:30~1000MHz

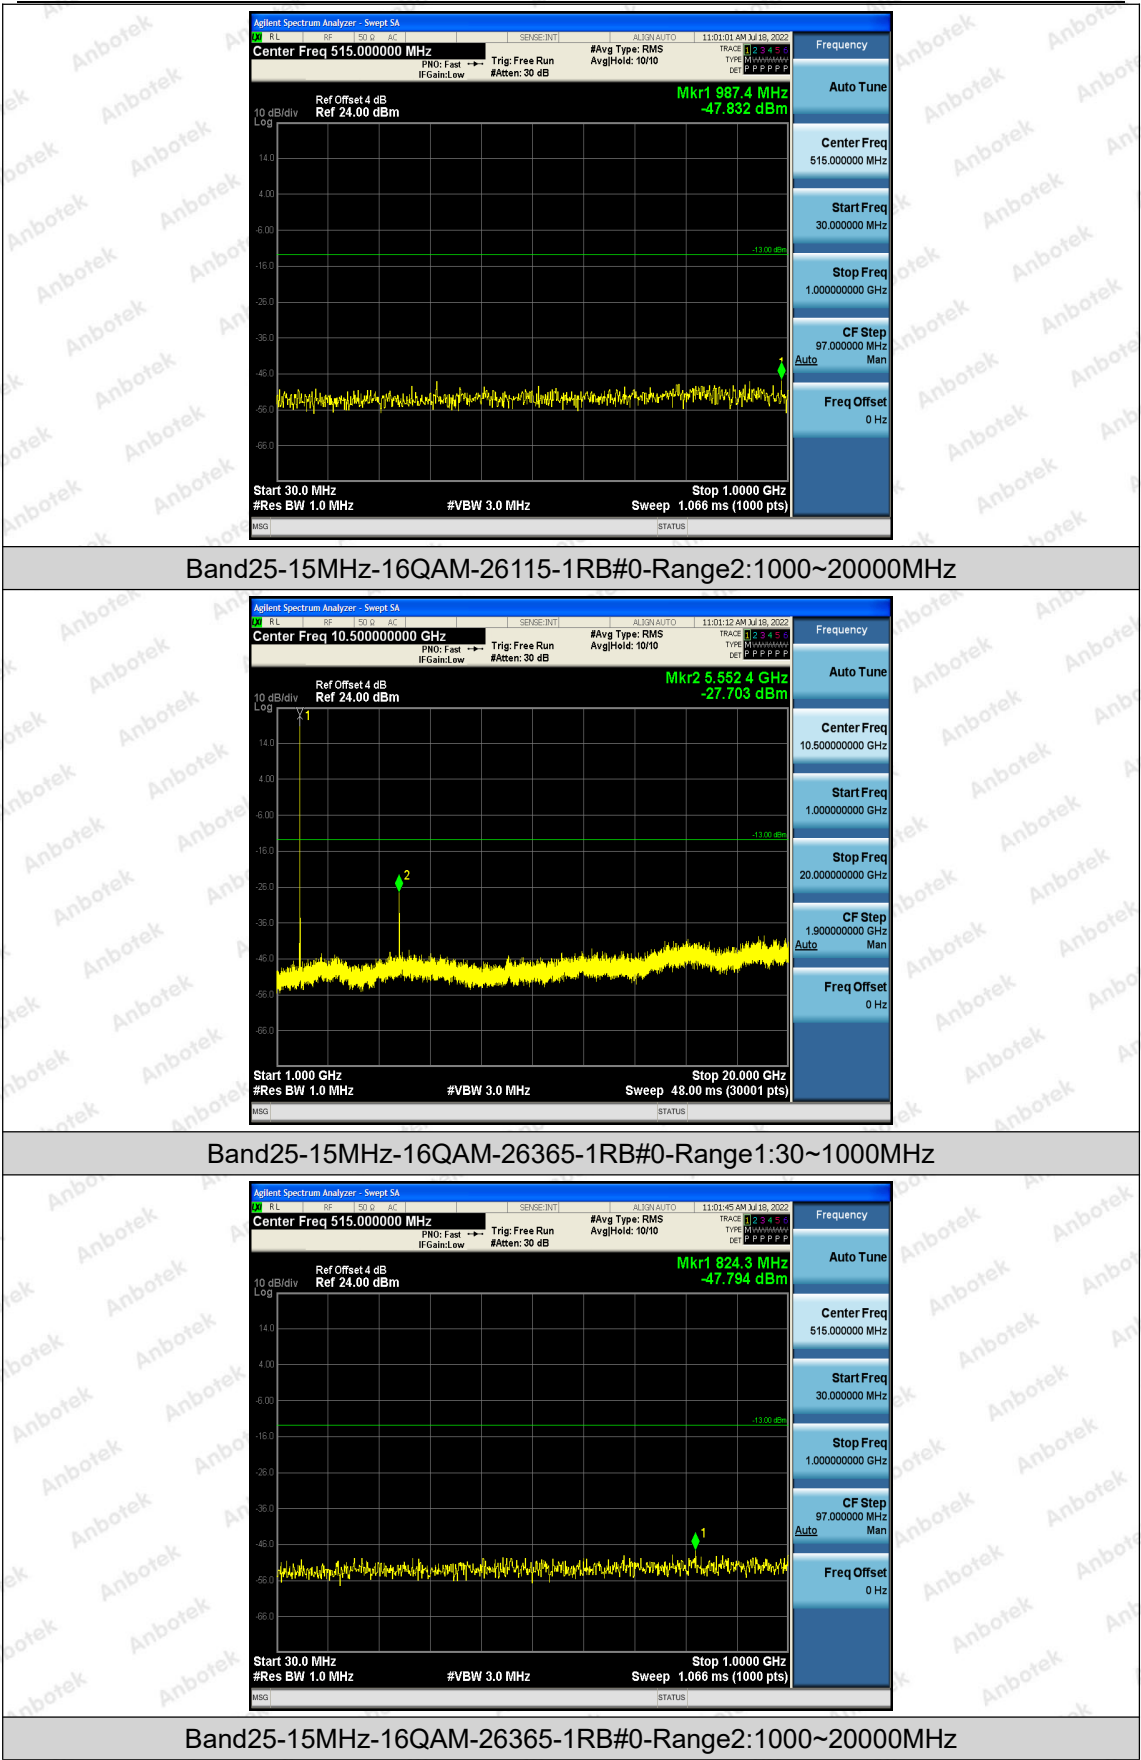


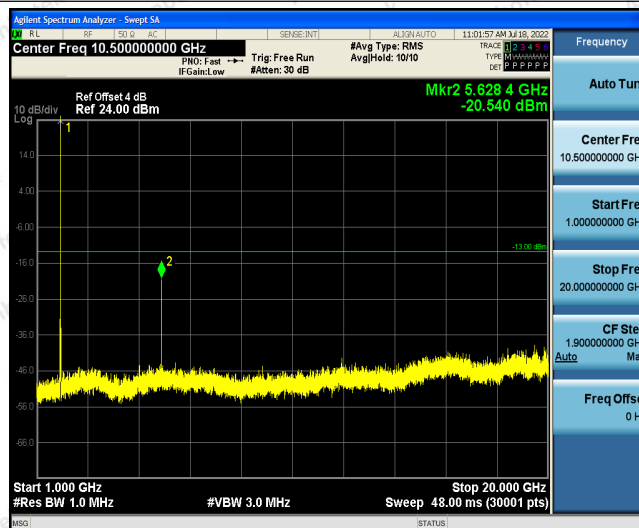


Band25-15MHz-16QAM-26615-1RB#0-Range1:30~1000MHz

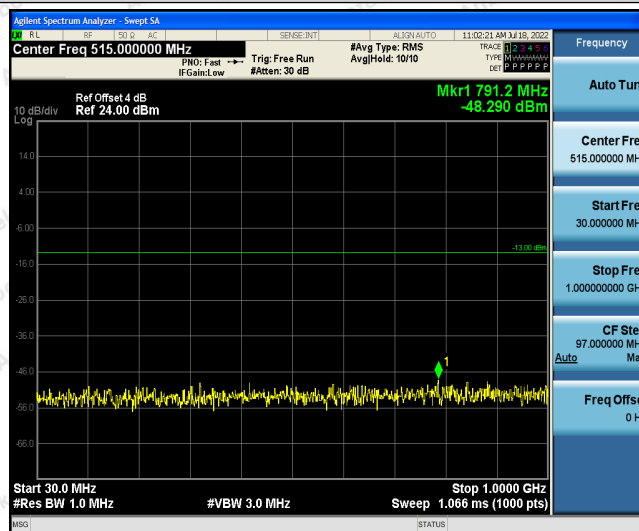


Band25-15MHz-16QAM-26615-1RB#0-Range2:1000~20000MHz

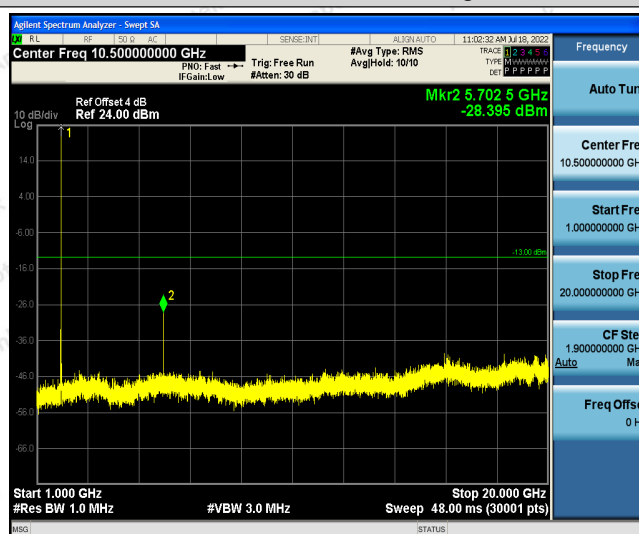


Band25-20MHz-QPSK-26140-1RB#0-Range1:30~1000MHz

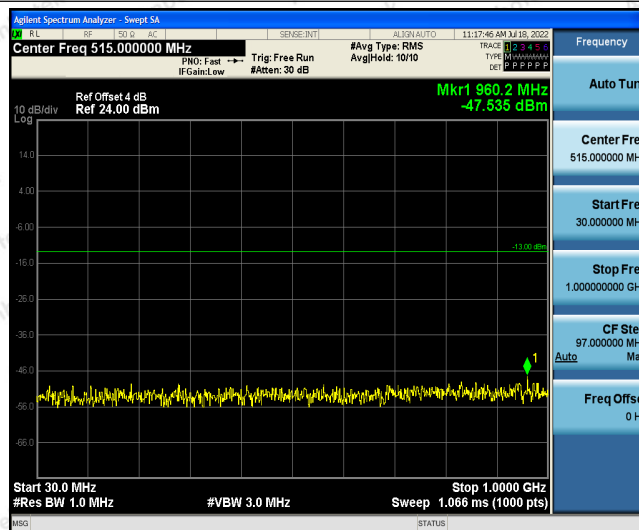


Band25-20MHz-QPSK-26140-1RB#0-Range2:1000~20000MHz

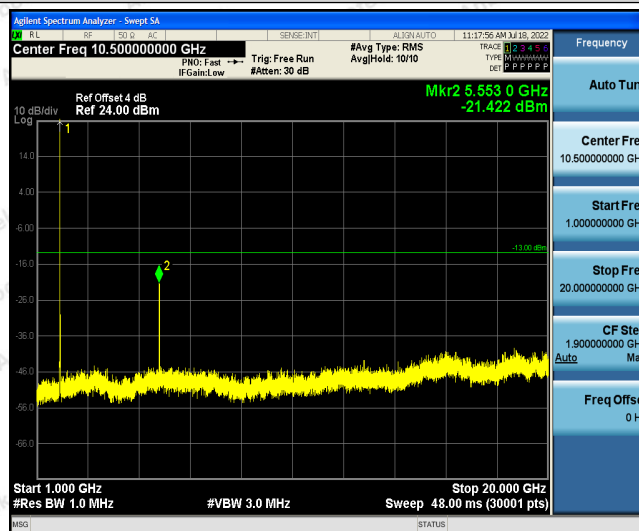


Band25-20MHz-QPSK-26365-1RB#0-Range1:30~1000MHz

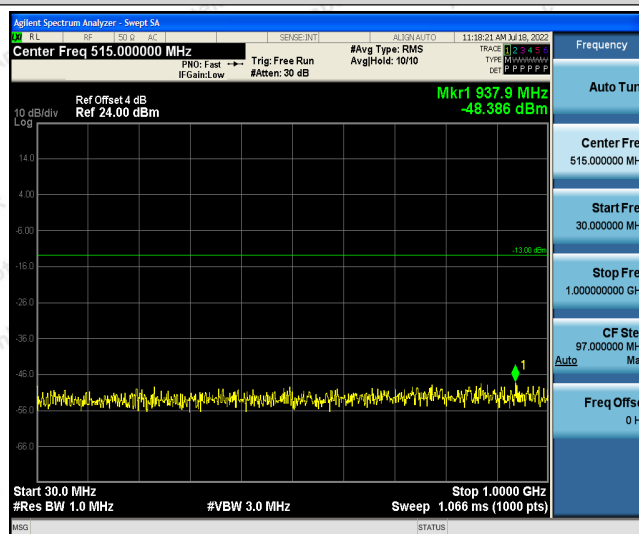


Band25-20MHz-QPSK-26365-1RB#0-Range2:1000~20000MHz

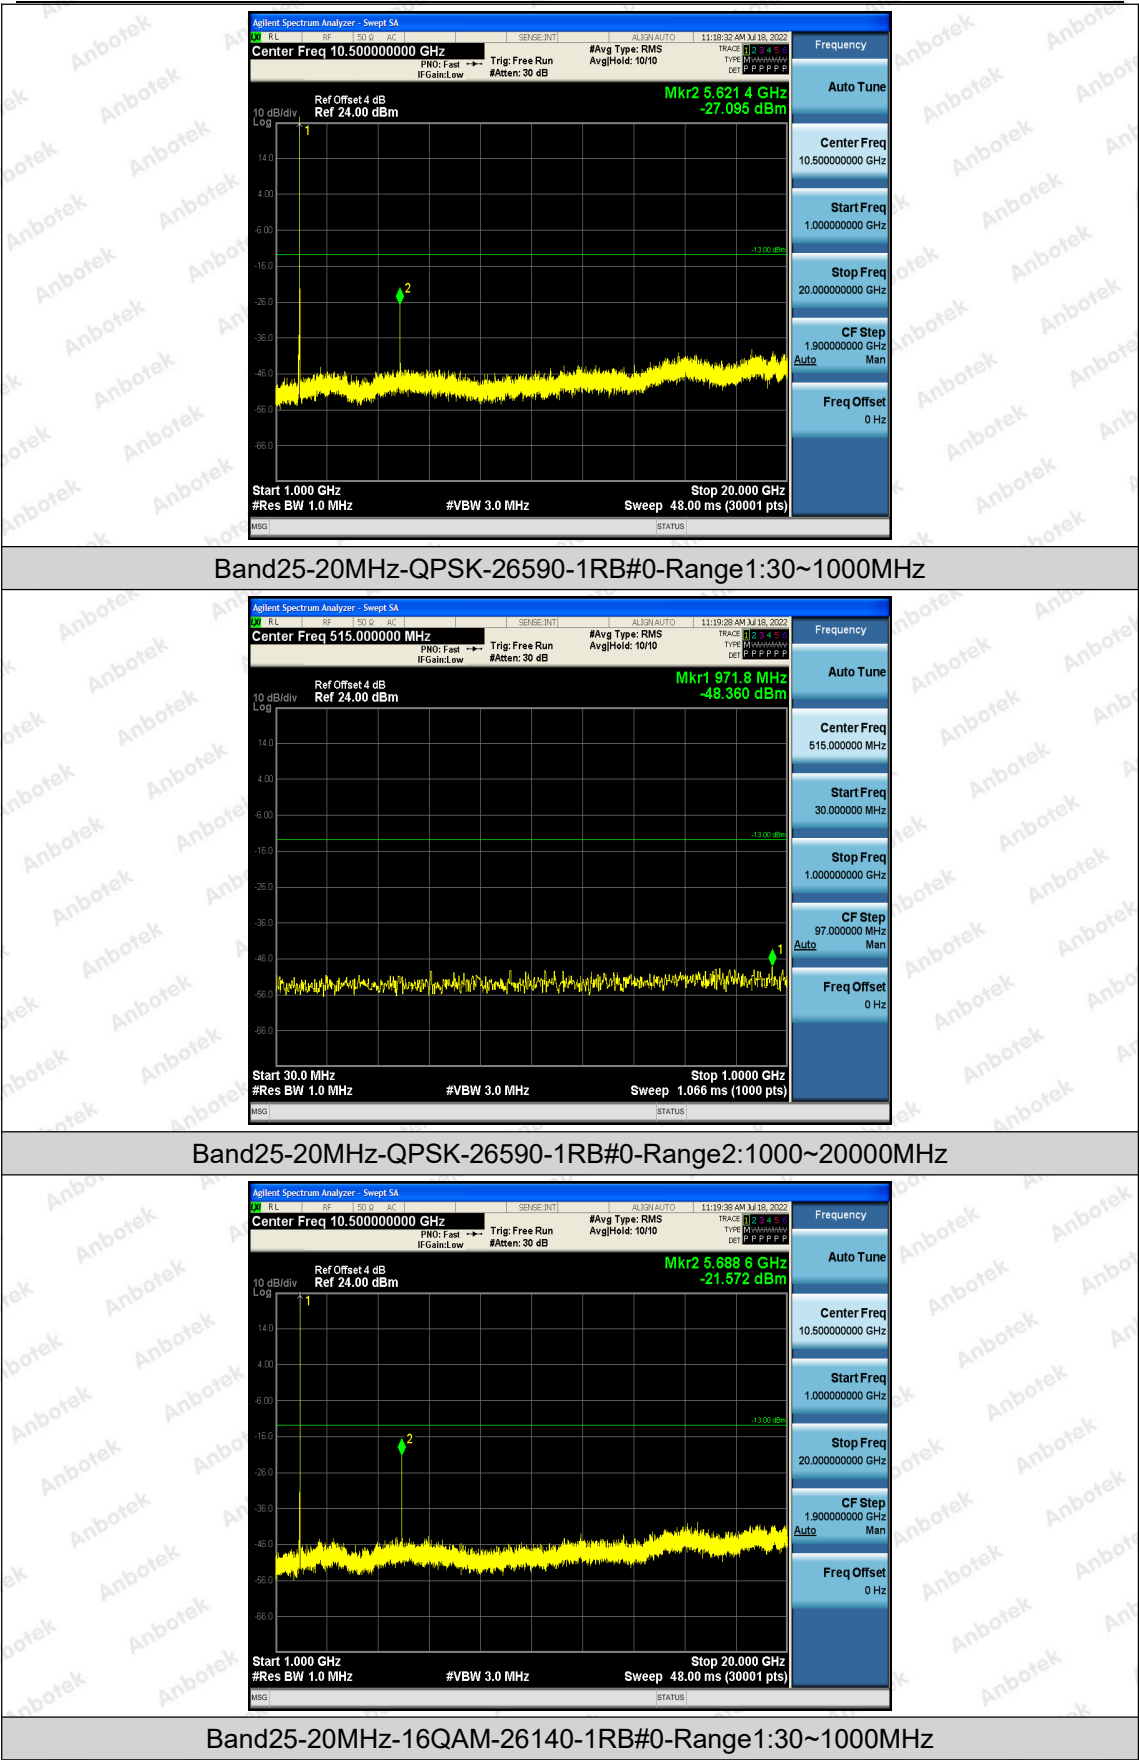


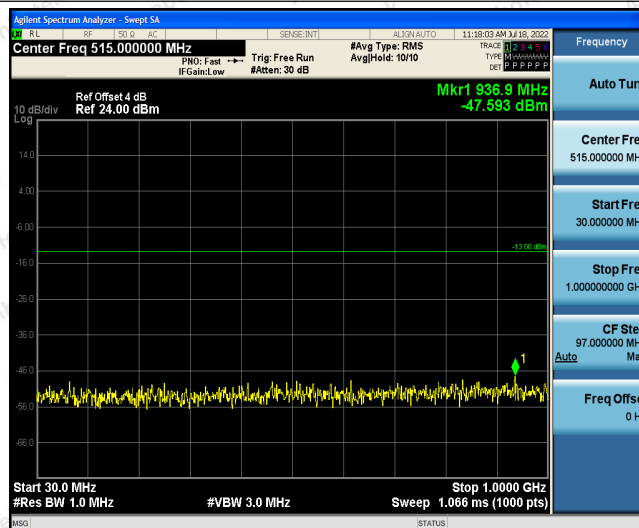

Band25-20MHz-16QAM-26140-1RB#0-Range2:1000~20000MHz

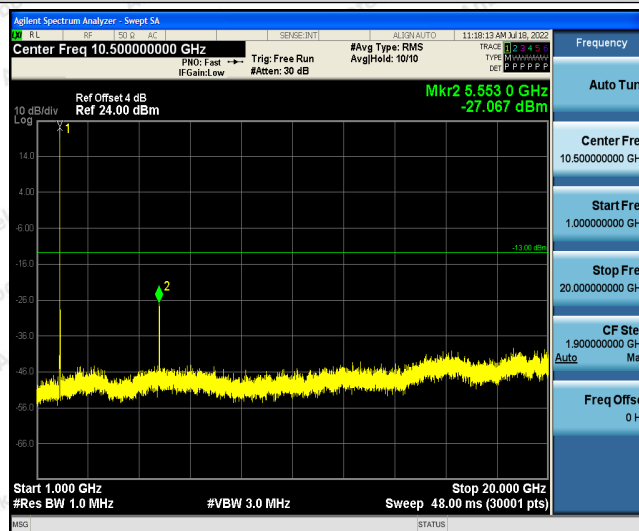

Band25-20MHz-16QAM-26365-1RB#0-Range1:30~1000MHz

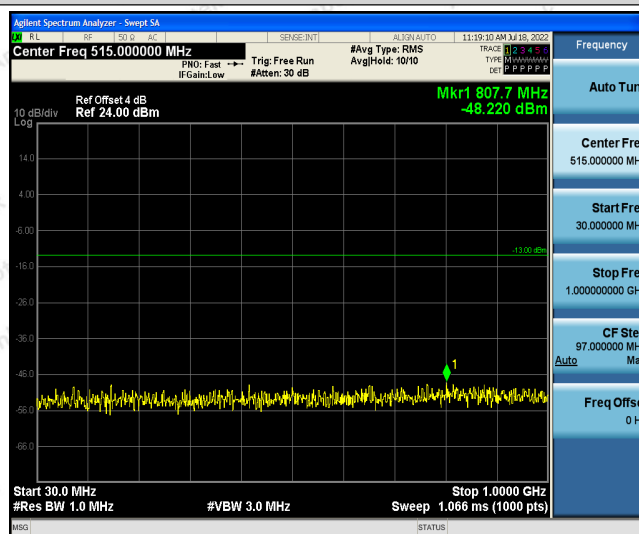

Band25-20MHz-16QAM-26365-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

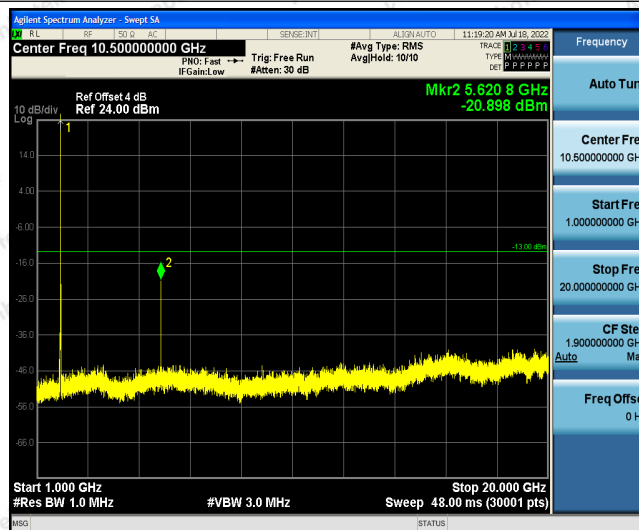

Band25-20MHz-16QAM-26590-1RB#0-Range1:30~1000MHz

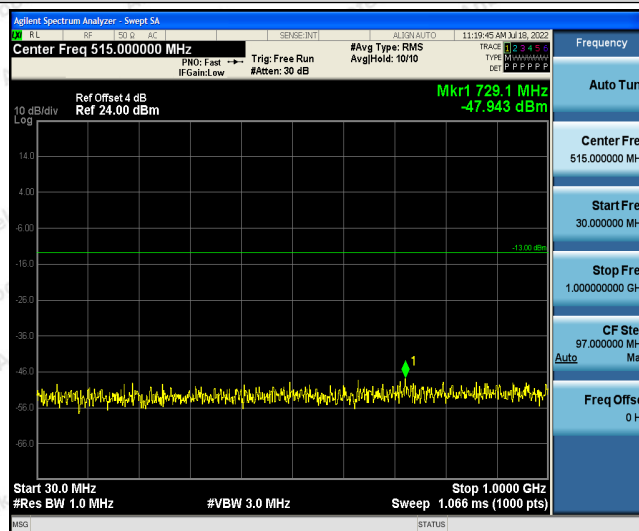

Band25-20MHz-16QAM-26590-1RB#0-Range2:1000~20000MHz

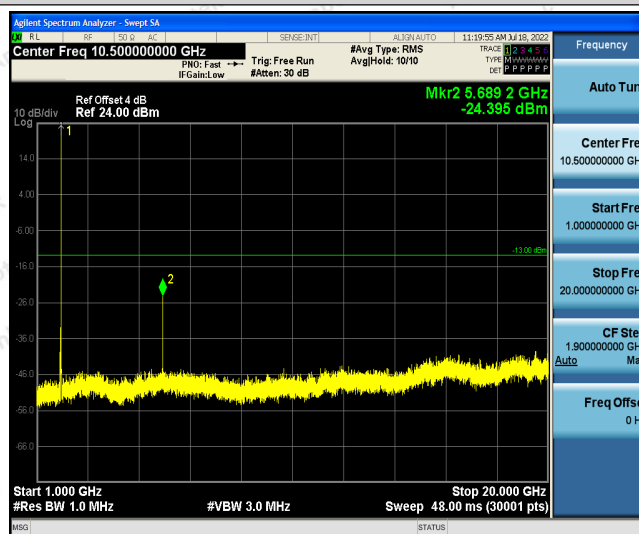

Band26-1.4MHz-QPSK-26797-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

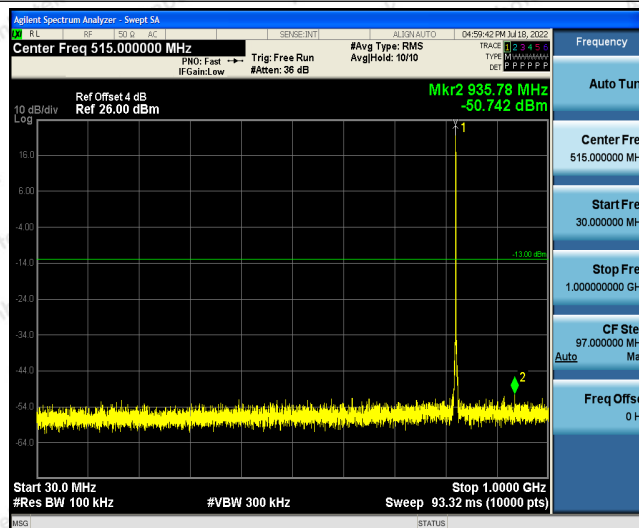


Band26-1.4MHz-QPSK-26797-1RB#0-Range2:1000~10000MHz

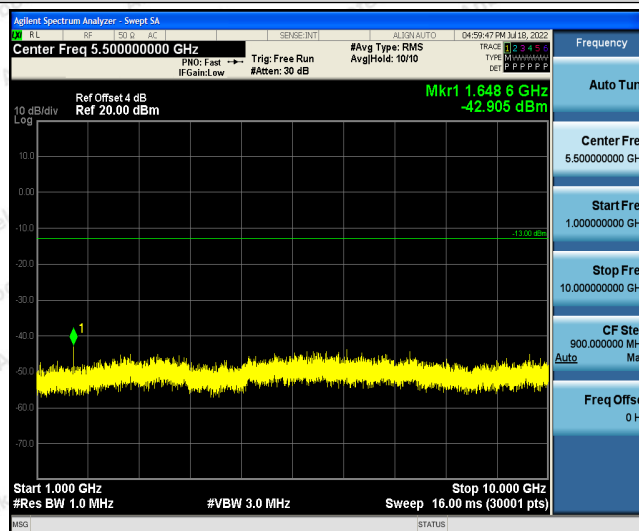


Band26-1.4MHz-QPSK-26915-1RB#0-Range1:30~1000MHz

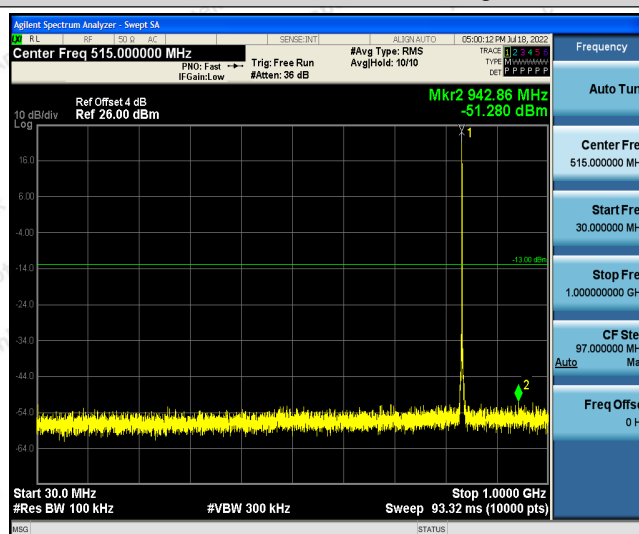


Band26-1.4MHz-QPSK-26915-1RB#0-Range2:1000~10000MHz

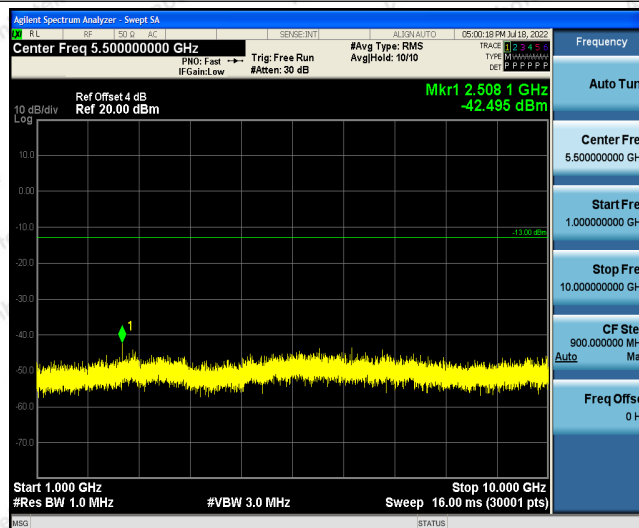


Band26-1.4MHz-QPSK-27033-1RB#0-Range1:30~1000MHz

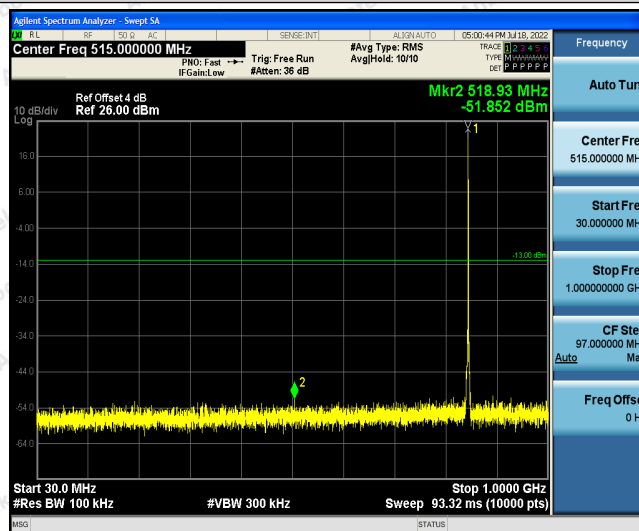


Band26-1.4MHz-QPSK-27033-1RB#0-Range2:1000~10000MHz

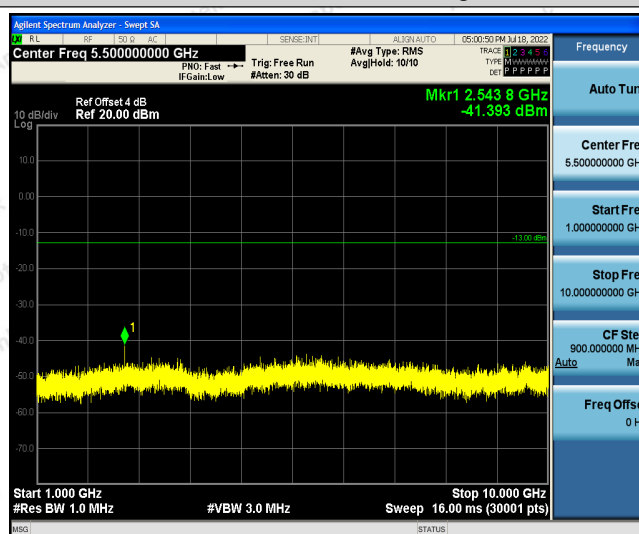


Band26-1.4MHz-16QAM-26797-1RB#0-Range1:30~1000MHz

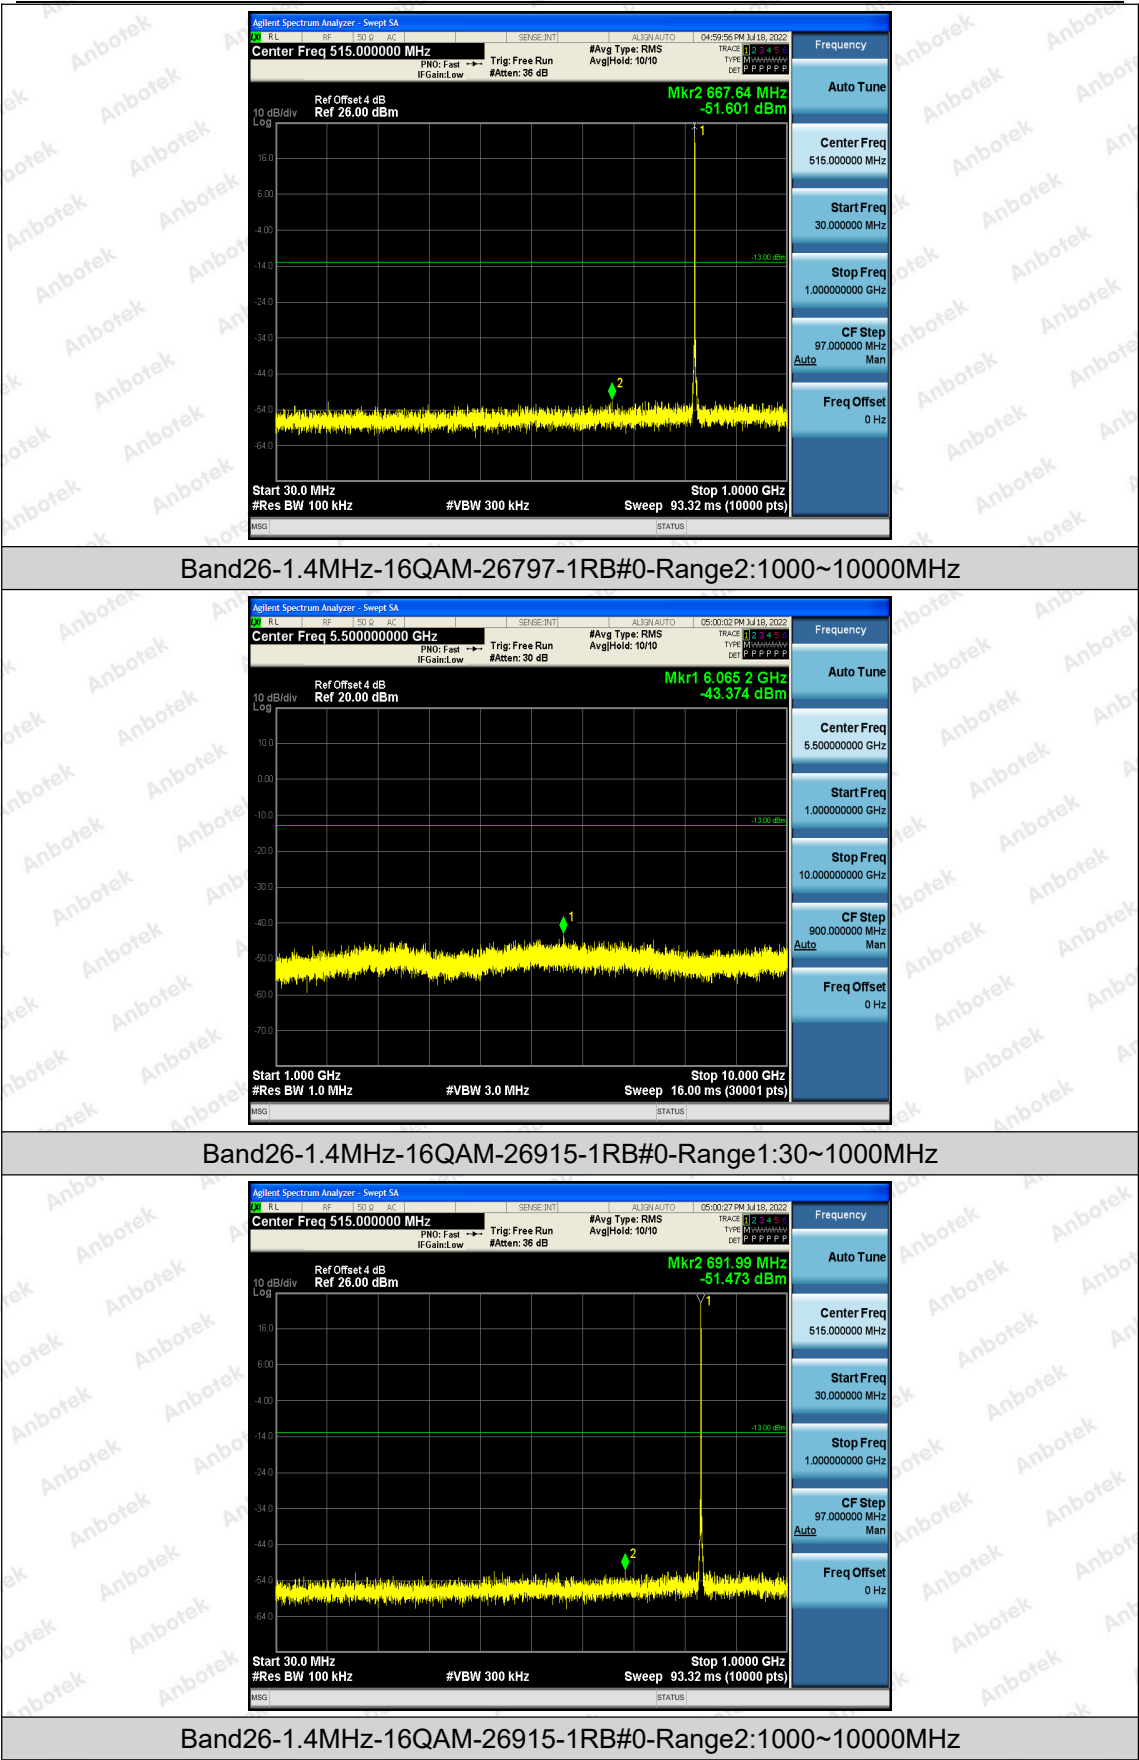


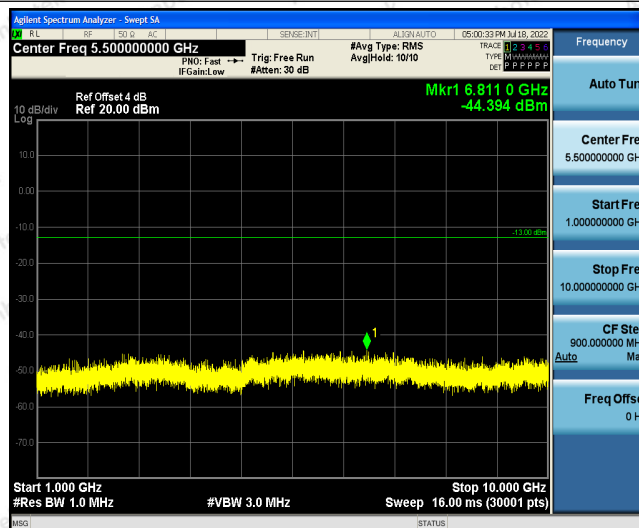


Band26-1.4MHz-16QAM-27033-1RB#0-Range1:30~1000MHz

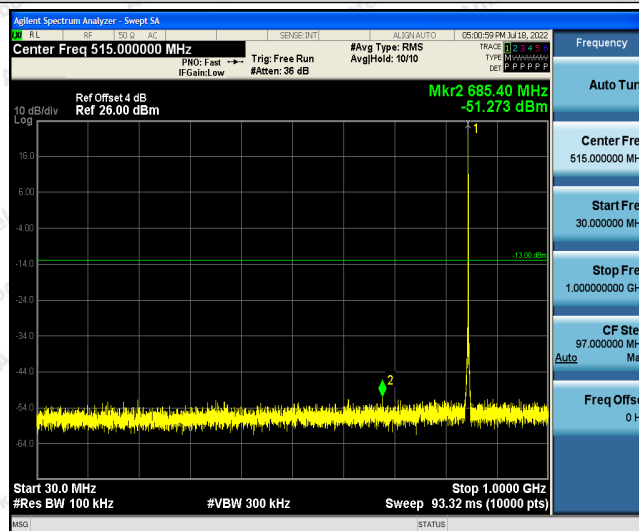


Band26-1.4MHz-16QAM-27033-1RB#0-Range2:1000~10000MHz

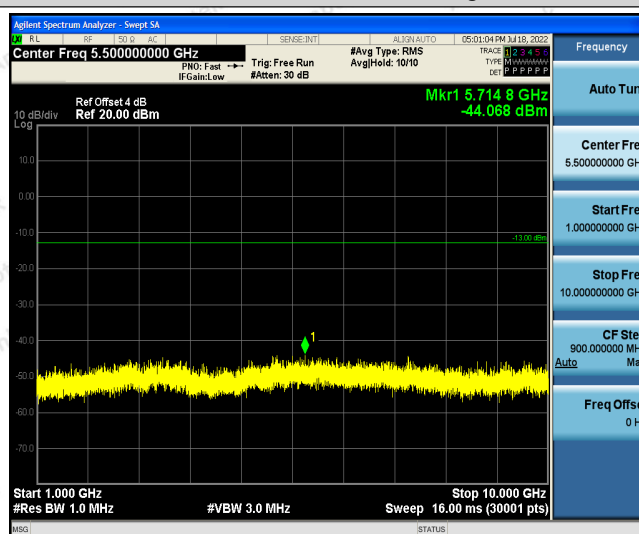


Band26-3MHz-QPSK-26805-1RB#0-Range1:30~1000MHz

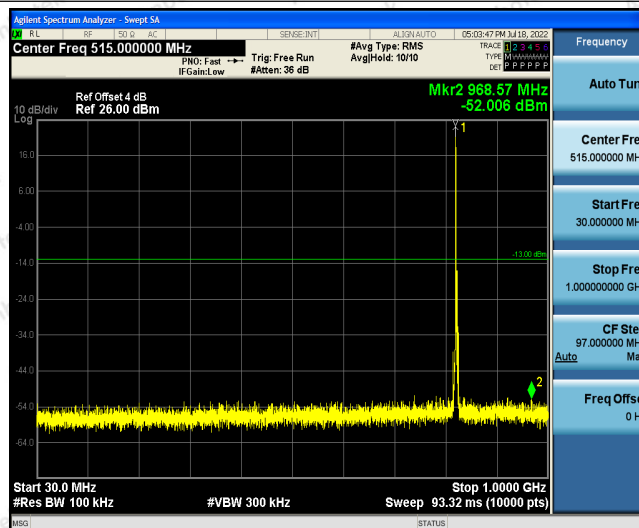


Band26-3MHz-QPSK-26805-1RB#0-Range2:1000~10000MHz

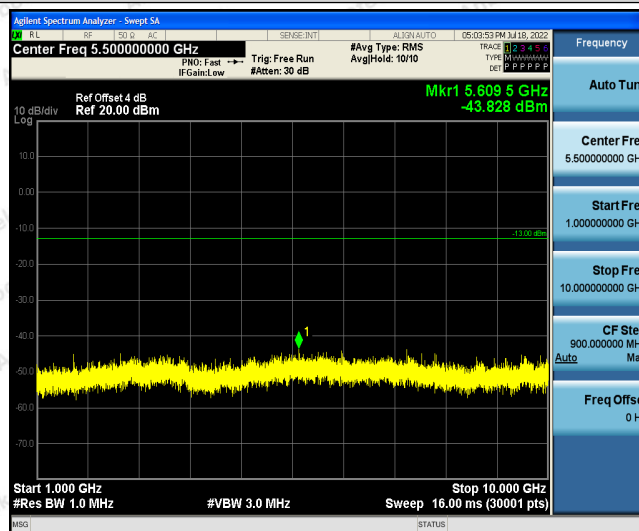


Band26-3MHz-QPSK-26915-1RB#0-Range1:30~1000MHz

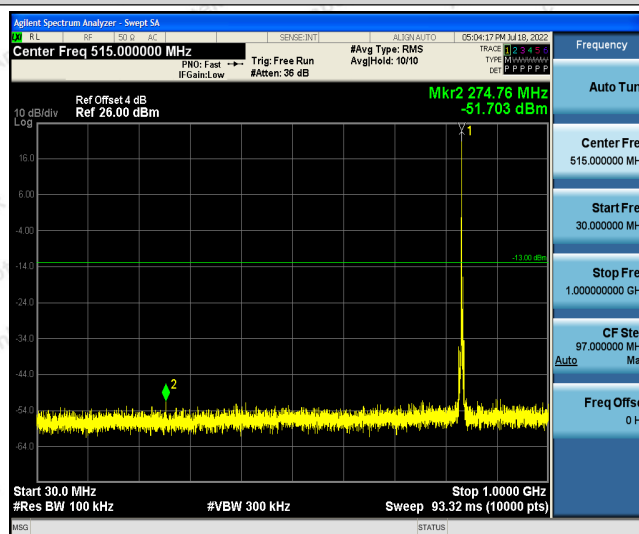


Band26-3MHz-QPSK-26915-1RB#0-Range2:1000~10000MHz

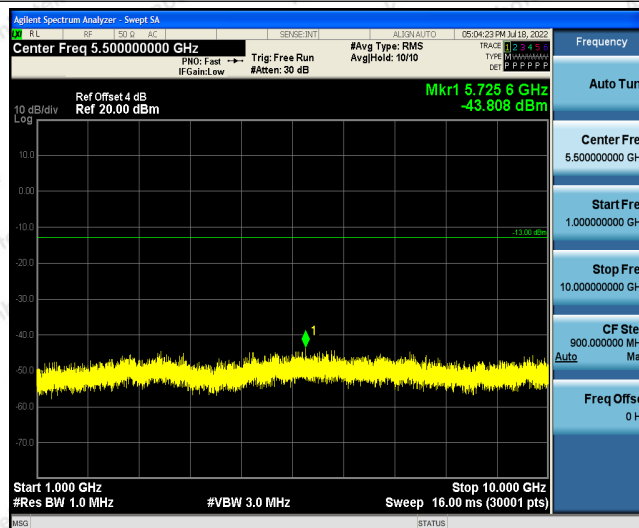


Band26-3MHz-QPSK-27025-1RB#0-Range1:30~1000MHz

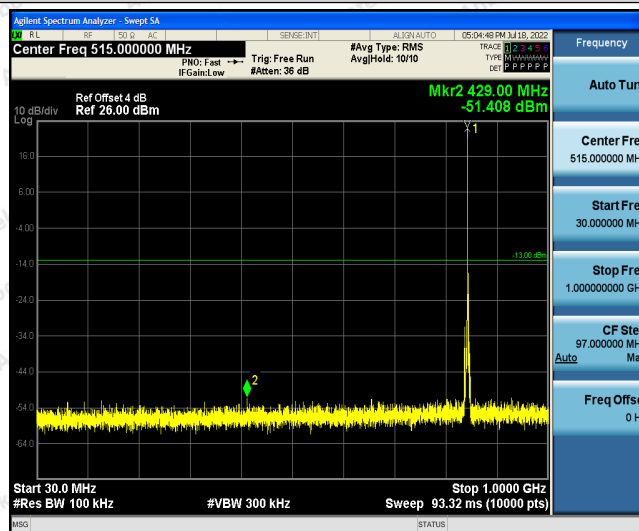


Band26-3MHz-QPSK-27025-1RB#0-Range2:1000~10000MHz

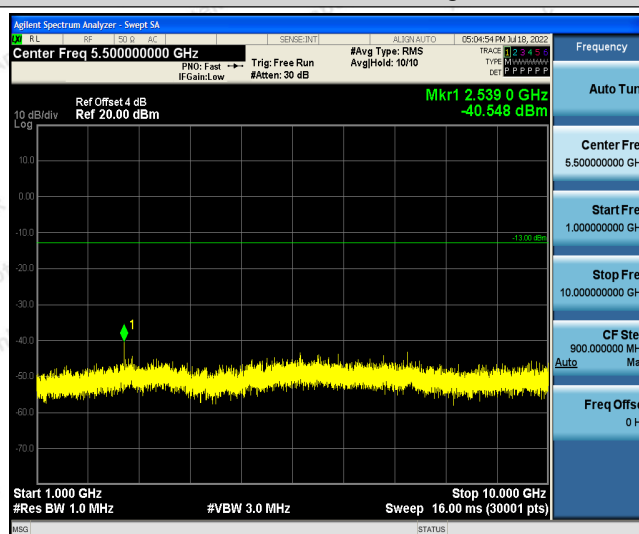


Band26-3MHz-16QAM-26805-1RB#0-Range1:30~1000MHz

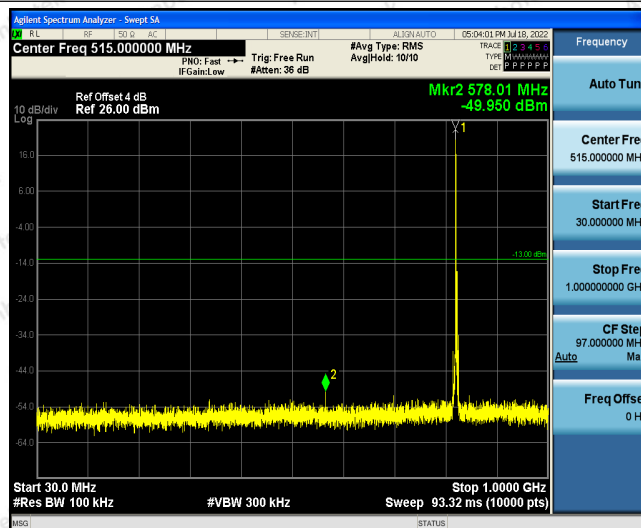


Band26-3MHz-16QAM-26805-1RB#0-Range2:1000~10000MHz

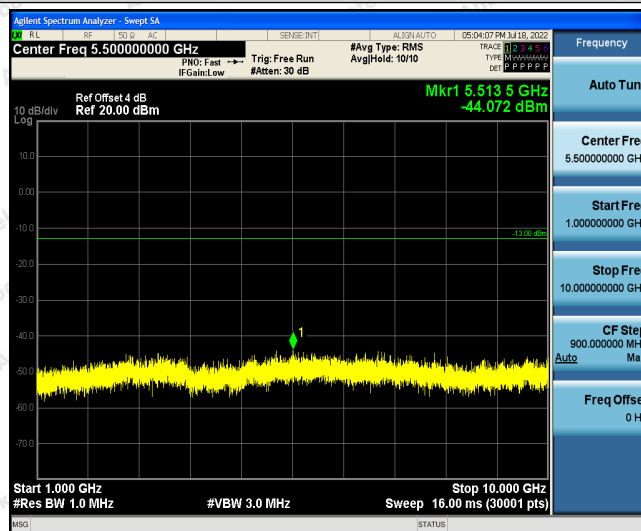


Band26-3MHz-16QAM-26915-1RB#0-Range1:30~1000MHz

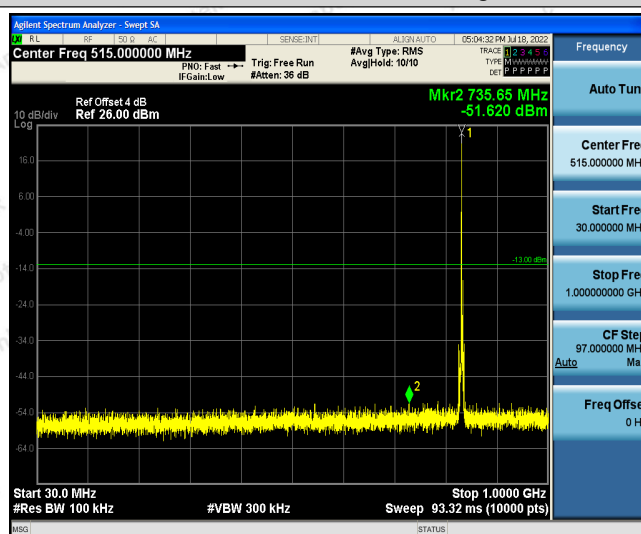


Band26-3MHz-16QAM-26915-1RB#0-Range2:1000~10000MHz

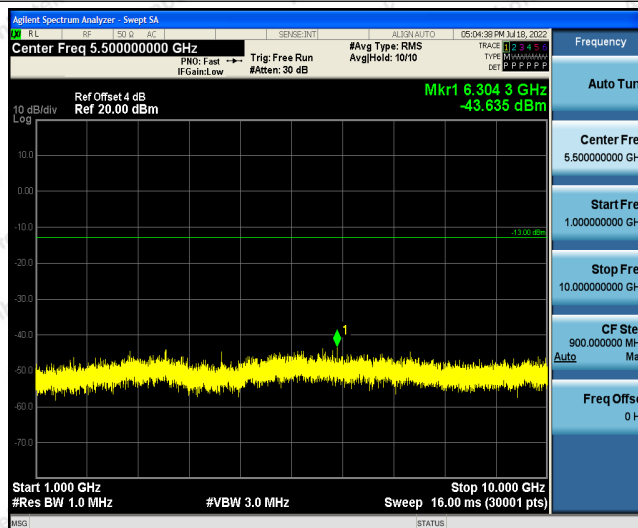


Band26-3MHz-16QAM-27025-1RB#0-Range1:30~1000MHz

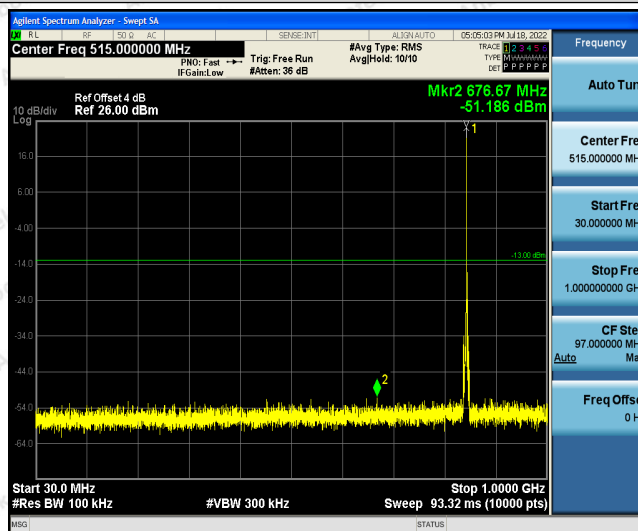


Band26-3MHz-16QAM-27025-1RB#0-Range2:1000~10000MHz

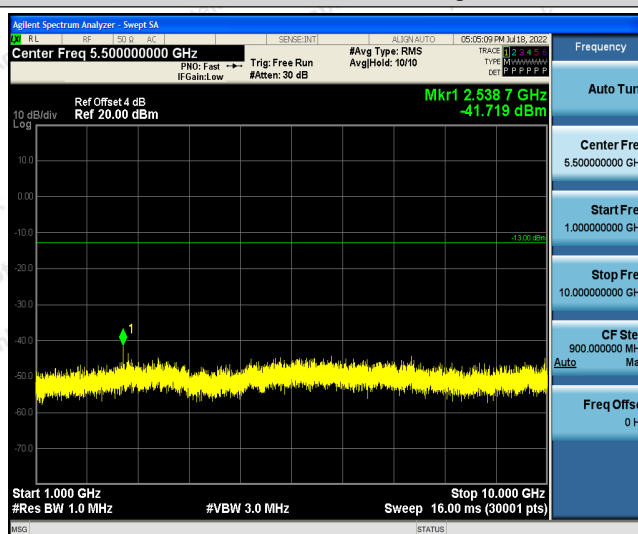


Band26-5MHz-QPSK-26815-1RB#0-Range1:30~1000MHz

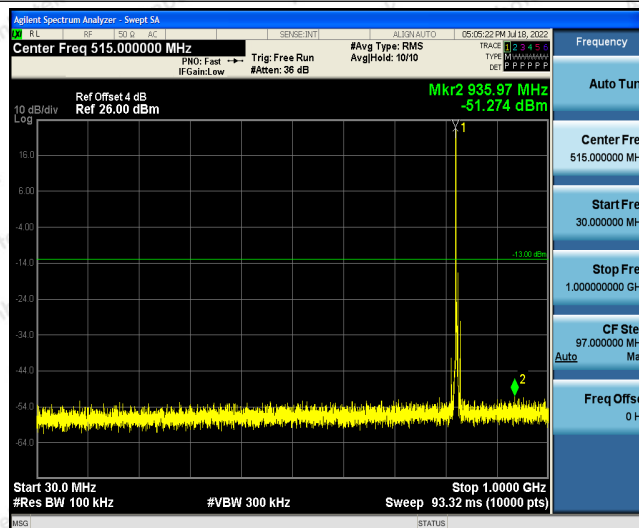


Band26-5MHz-QPSK-26815-1RB#0-Range2:1000~10000MHz

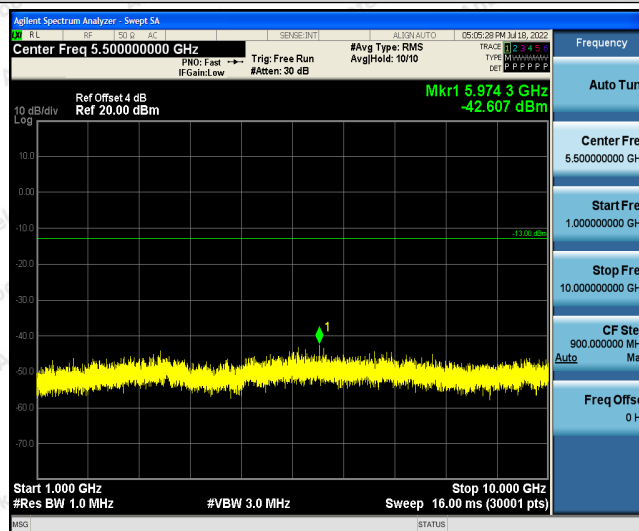


Band26-5MHz-QPSK-26915-1RB#0-Range1:30~1000MHz

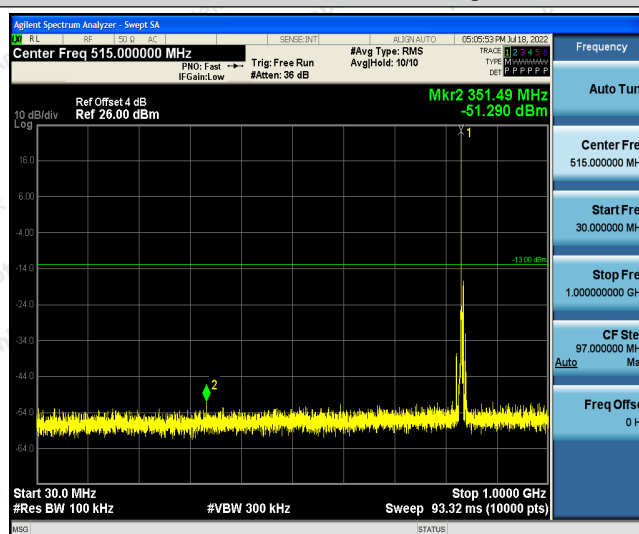


Band26-5MHz-QPSK-26915-1RB#0-Range2:1000~10000MHz

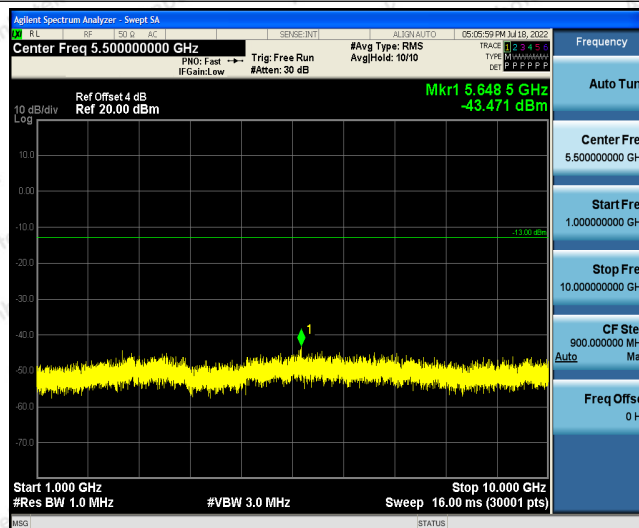


Band26-5MHz-QPSK-27015-1RB#0-Range1:30~1000MHz

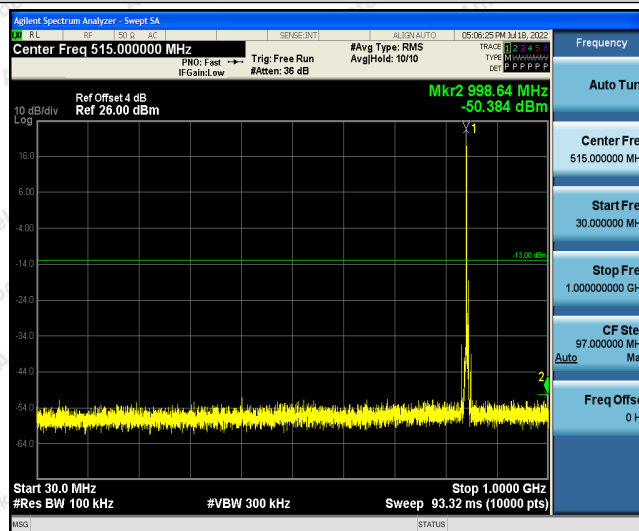


Band26-5MHz-QPSK-27015-1RB#0-Range2:1000~10000MHz

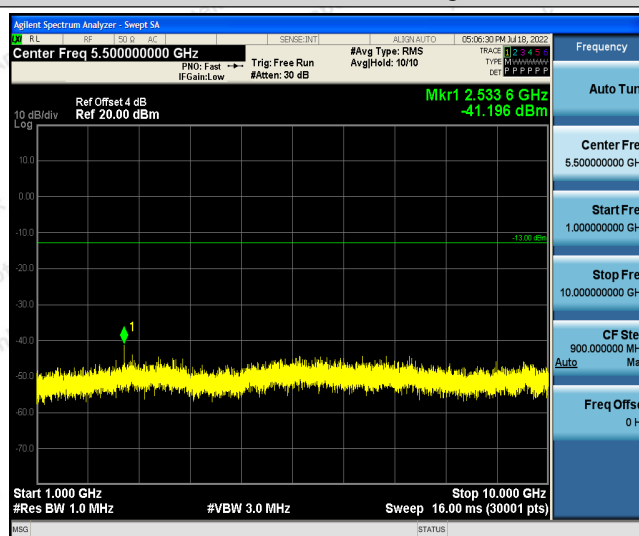


Band26-5MHz-16QAM-26815-1RB#0-Range1:30~1000MHz

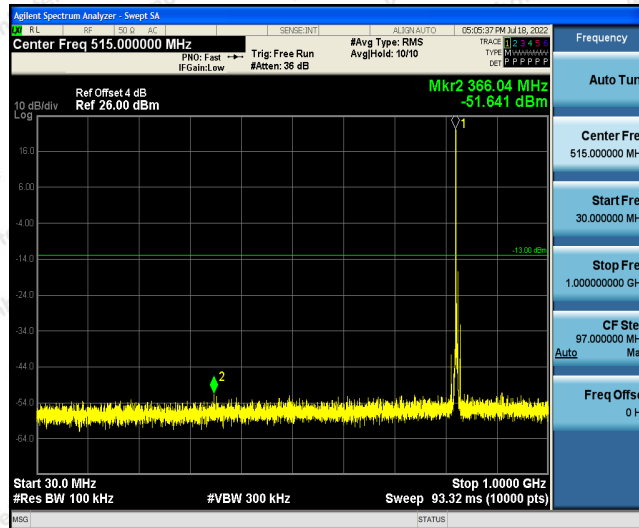


Band26-5MHz-16QAM-26815-1RB#0-Range2:1000~10000MHz

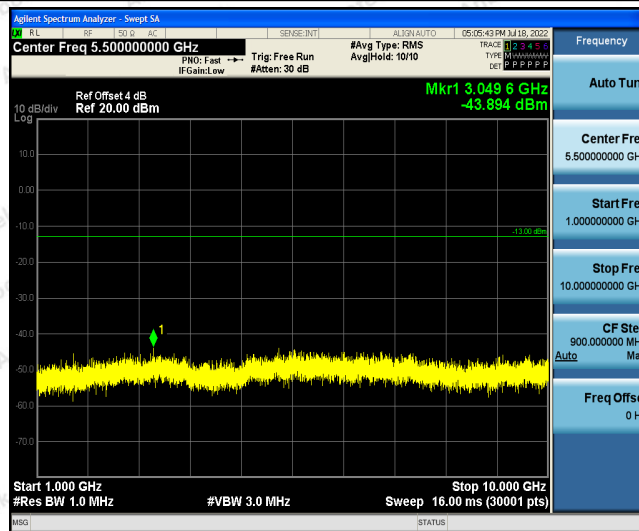


Band26-5MHz-16QAM-26915-1RB#0-Range1:30~1000MHz

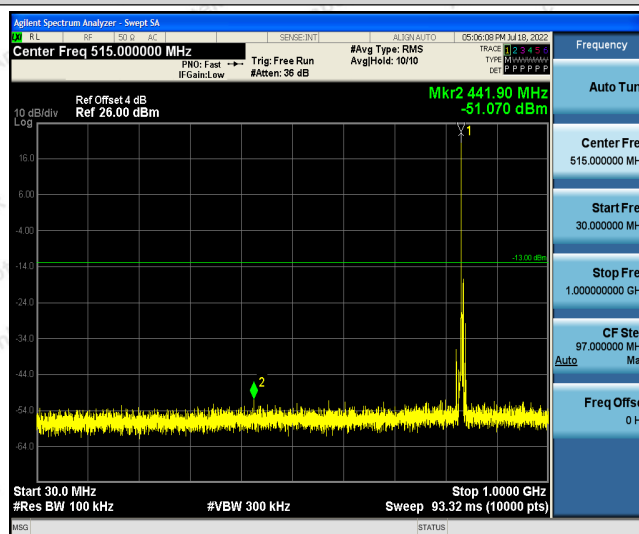


Band26-5MHz-16QAM-26915-1RB#0-Range2:1000~10000MHz

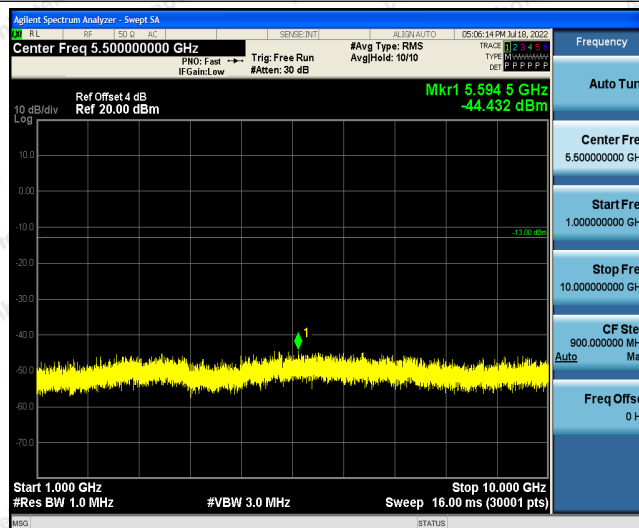


Band26-5MHz-16QAM-27015-1RB#0-Range1:30~1000MHz

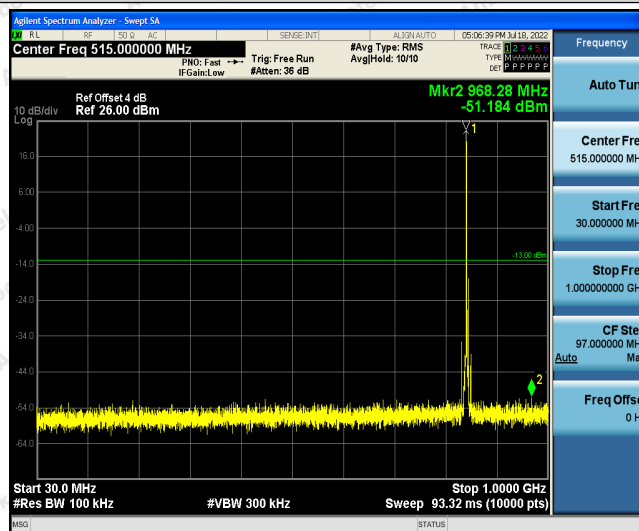


Band26-5MHz-16QAM-27015-1RB#0-Range2:1000~10000MHz

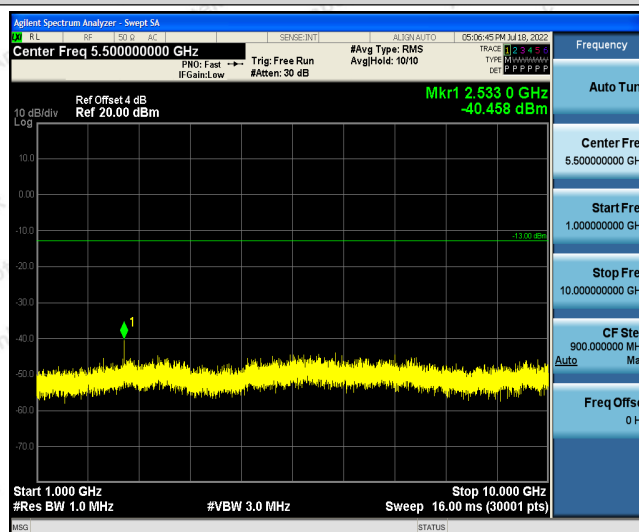


Band26-10MHz-QPSK-26840-1RB#0-Range1:30~1000MHz

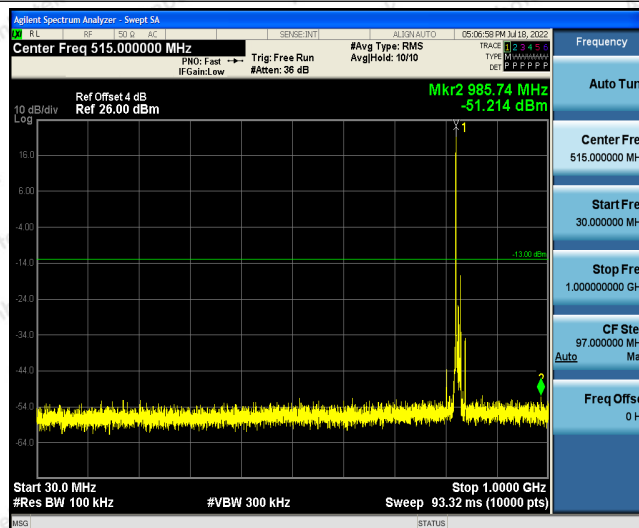


Band26-10MHz-QPSK-26840-1RB#0-Range2: 1000~10000MHz

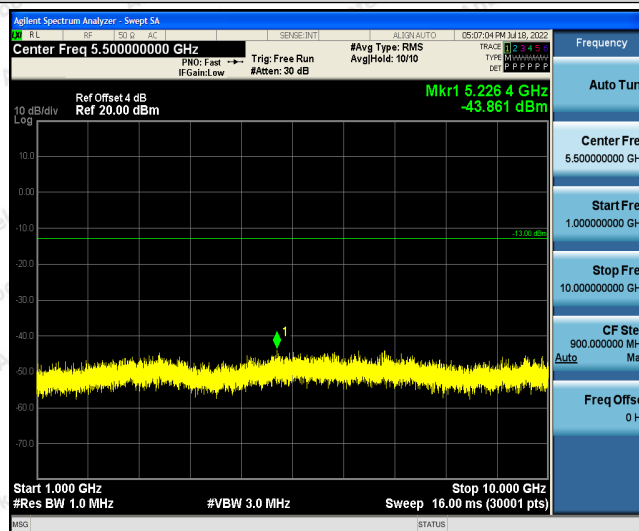


Band26-10MHz-QPSK-26915-1RB#0-Range1:30~1000MHz

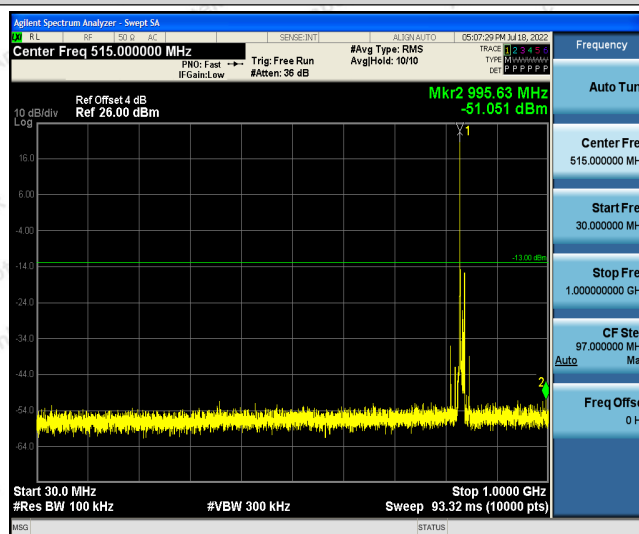


Band26-10MHz-QPSK-26915-1RB#0-Range2: 1000~10000MHz

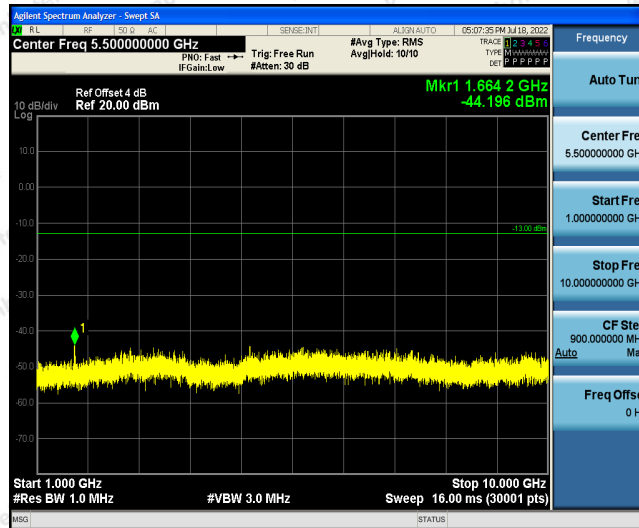


Band26-10MHz-QPSK-26990-1RB#0-Range1:30~1000MHz

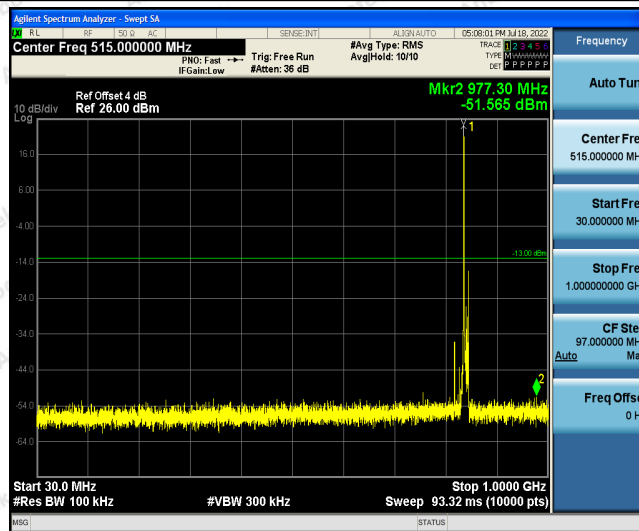


Band26-10MHz-QPSK-26990-1RB#0-Range2:1000~10000MHz

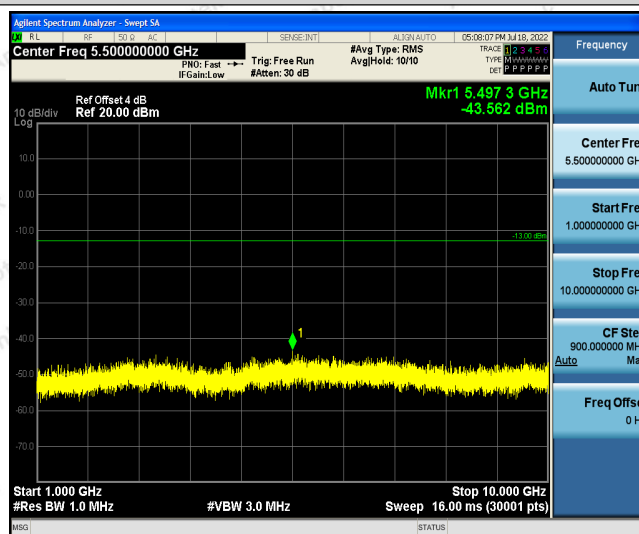


Band26-10MHz-16QAM-26840-1RB#0-Range1:30~1000MHz

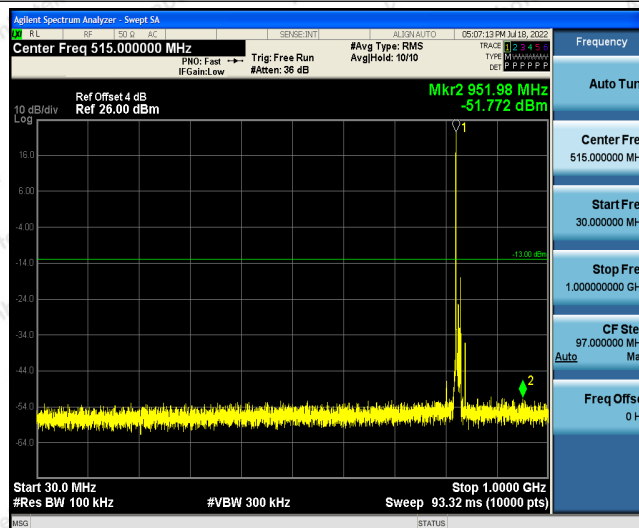


Band26-10MHz-16QAM-26840-1RB#0-Range2:1000~10000MHz

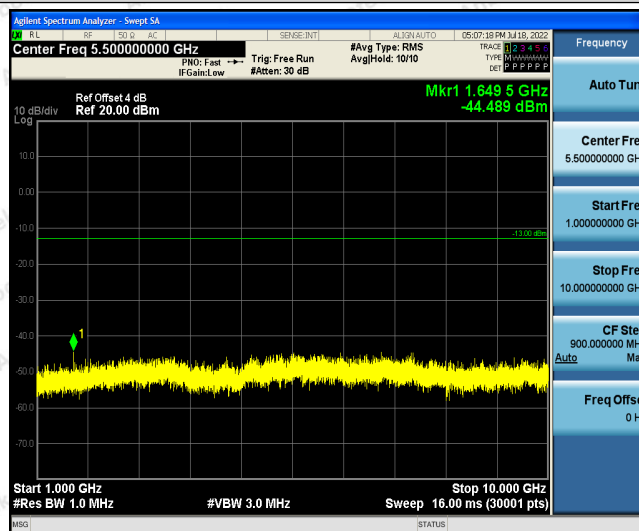


Band26-10MHz-16QAM-26915-1RB#0-Range1:30~1000MHz

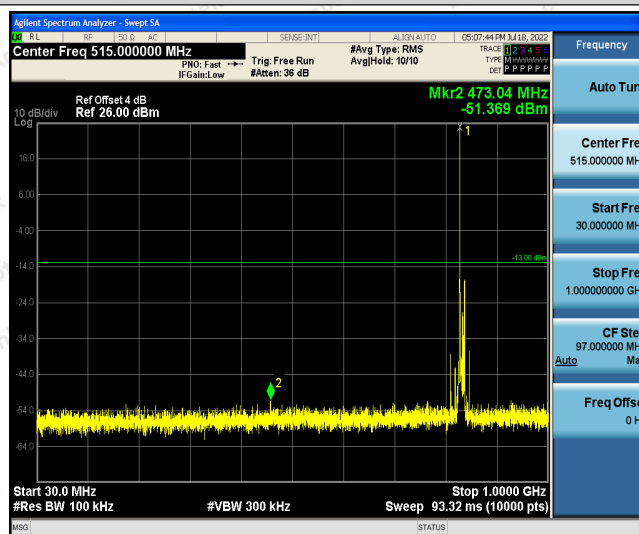


Band26-10MHz-16QAM-26915-1RB#0-Range2:1000~10000MHz

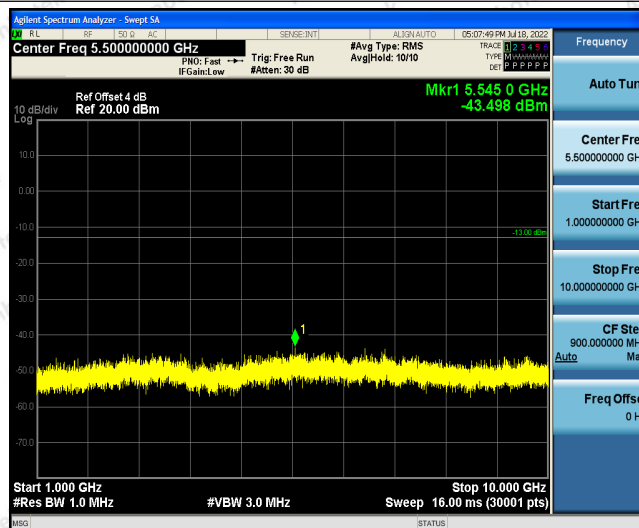


Band26-10MHz-16QAM-26990-1RB#0-Range1:30~1000MHz

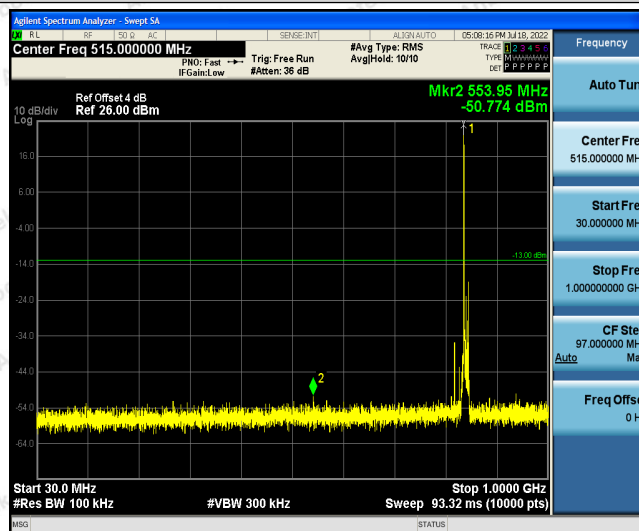


Band26-10MHz-16QAM-26990-1RB#0-Range2:1000~10000MHz

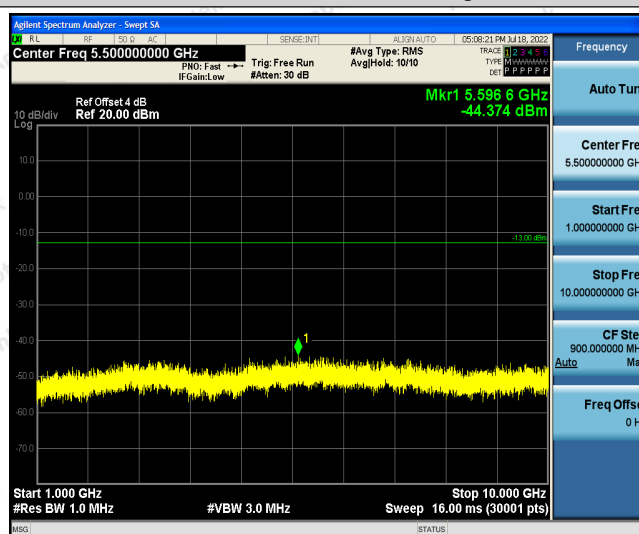


Band26-15MHz-QPSK-26865-1RB#0-Range1:30~1000MHz

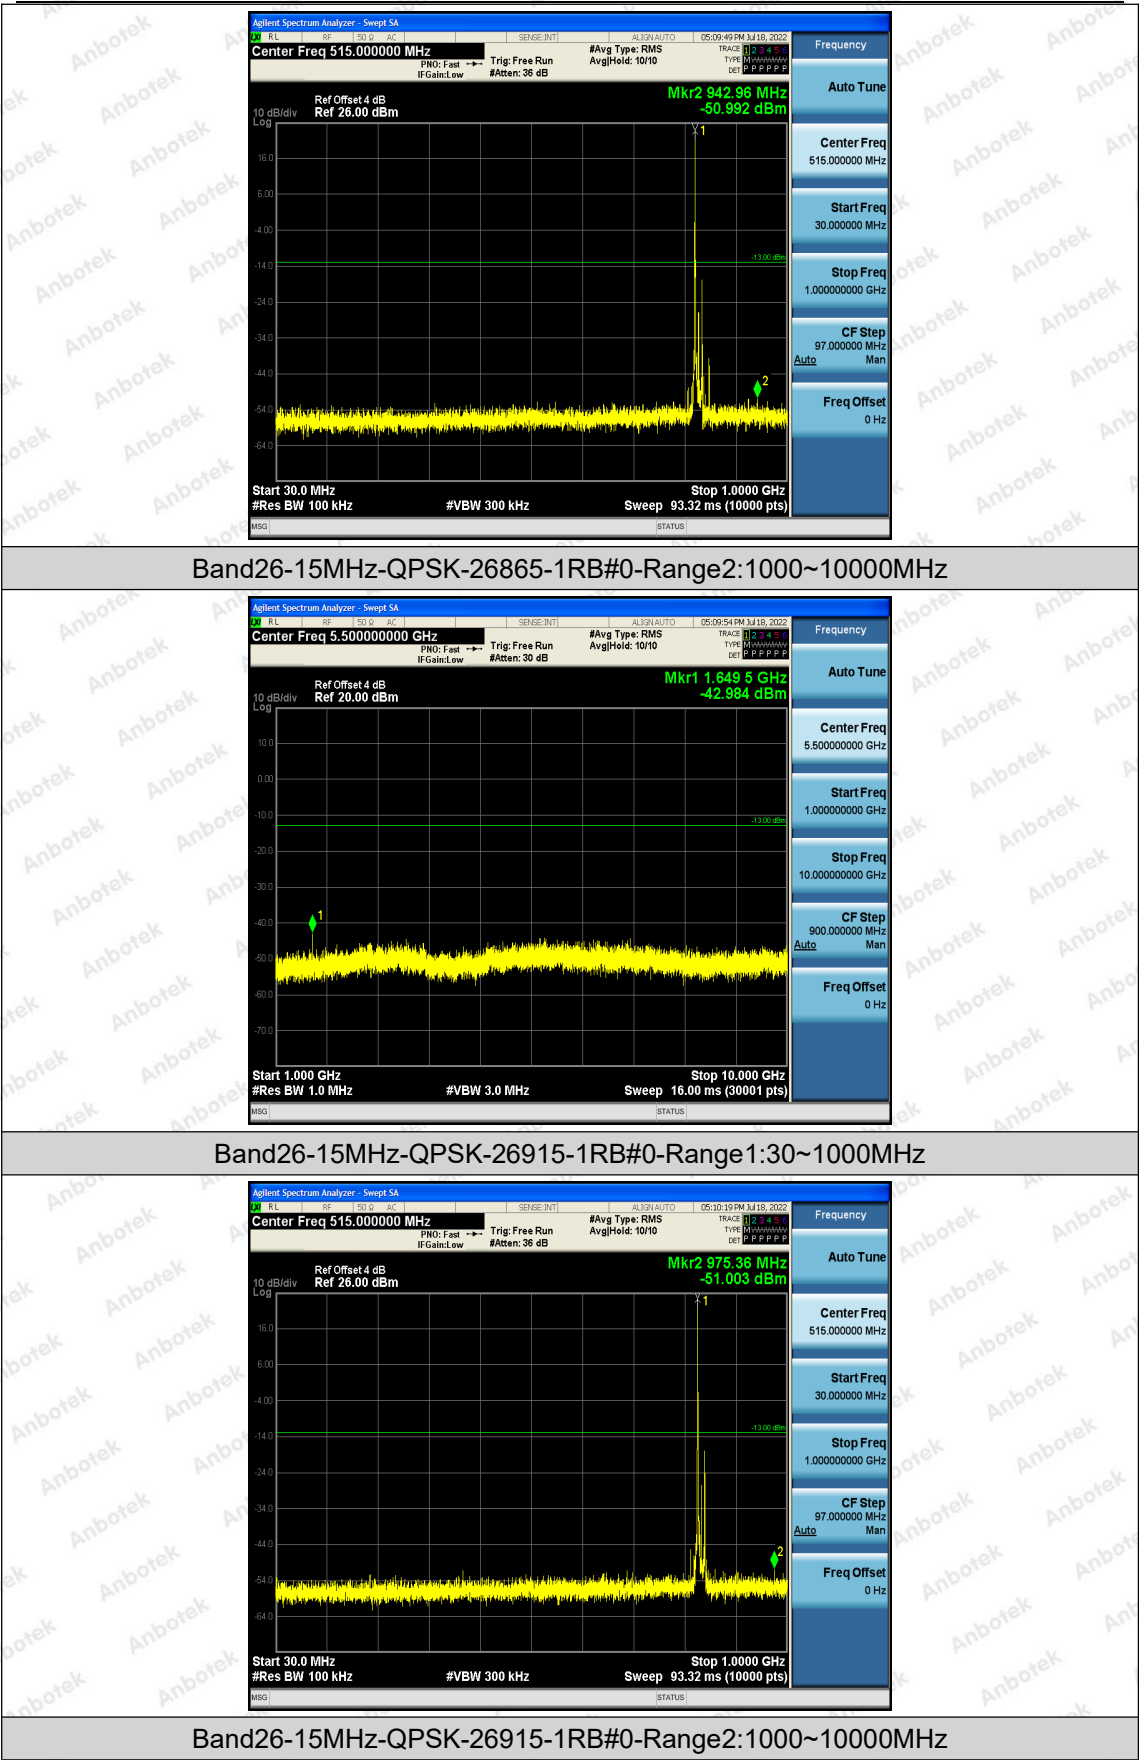


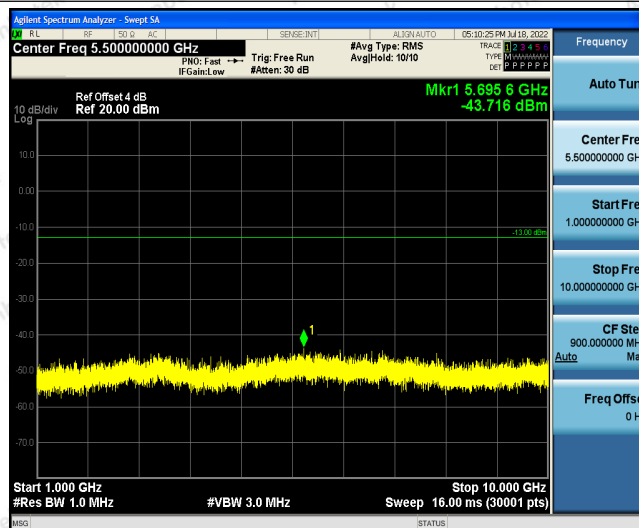


Band26-15MHz-QPSK-26965-1RB#0-Range1:30~1000MHz

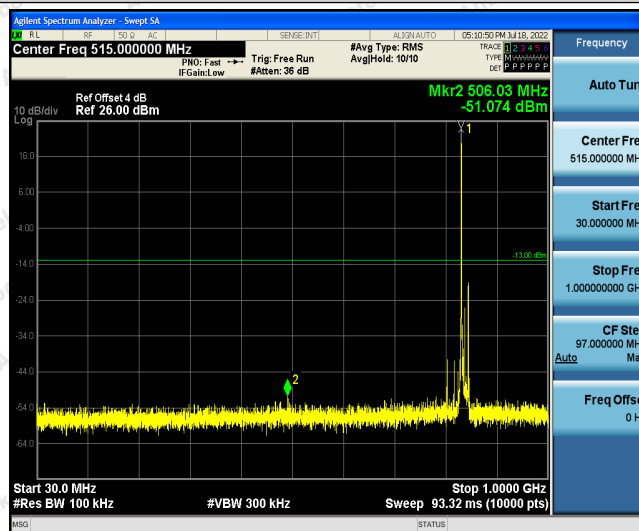


Band26-15MHz-QPSK-26965-1RB#0-Range2:1000~10000MHz

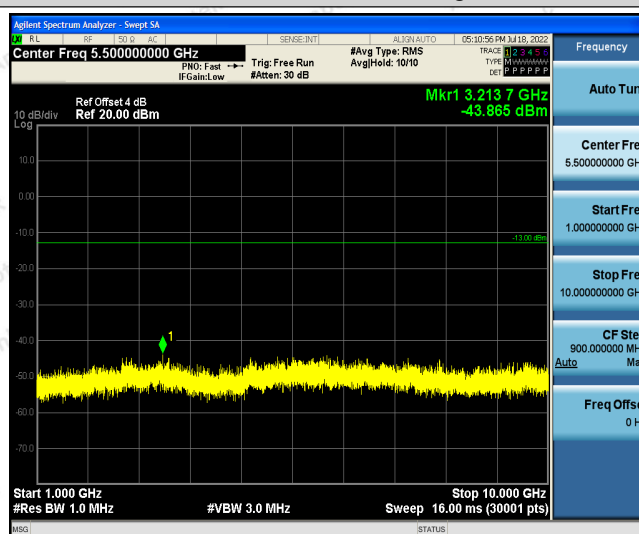


Band26-15MHz-16QAM-26865-1RB#0-Range1:30~1000MHz

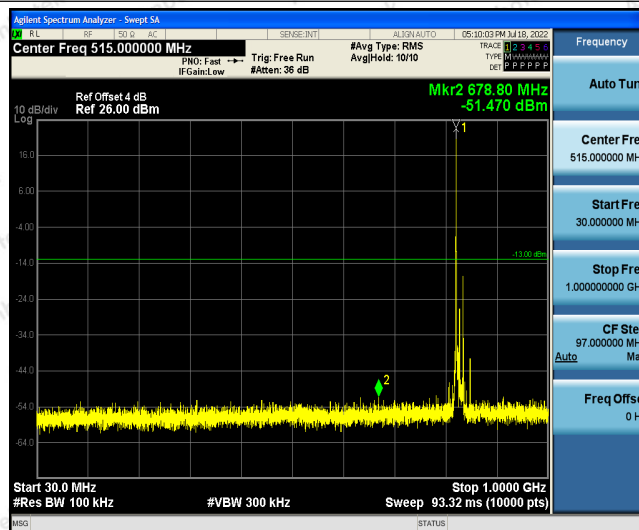


Band26-15MHz-16QAM-26865-1RB#0-Range2:1000~10000MHz

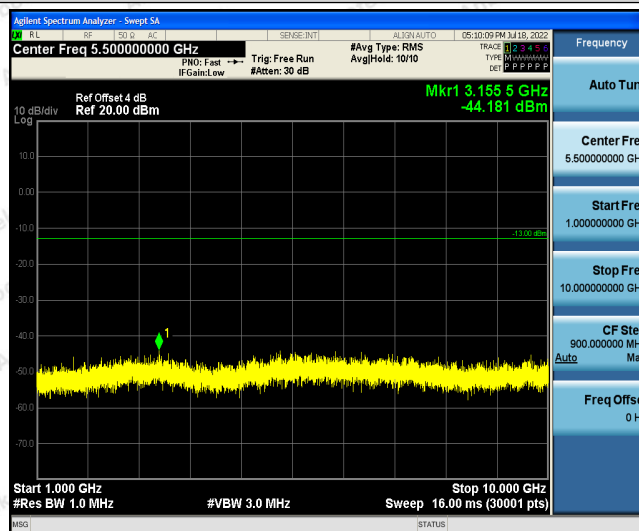

Band26-15MHz-16QAM-26915-1RB#0-Range1:30~1000MHz

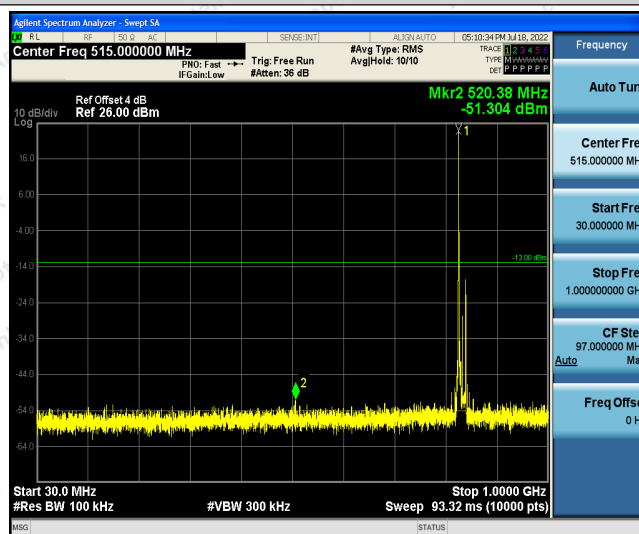

Band26-15MHz-16QAM-26915-1RB#0-Range2:1000~10000MHz

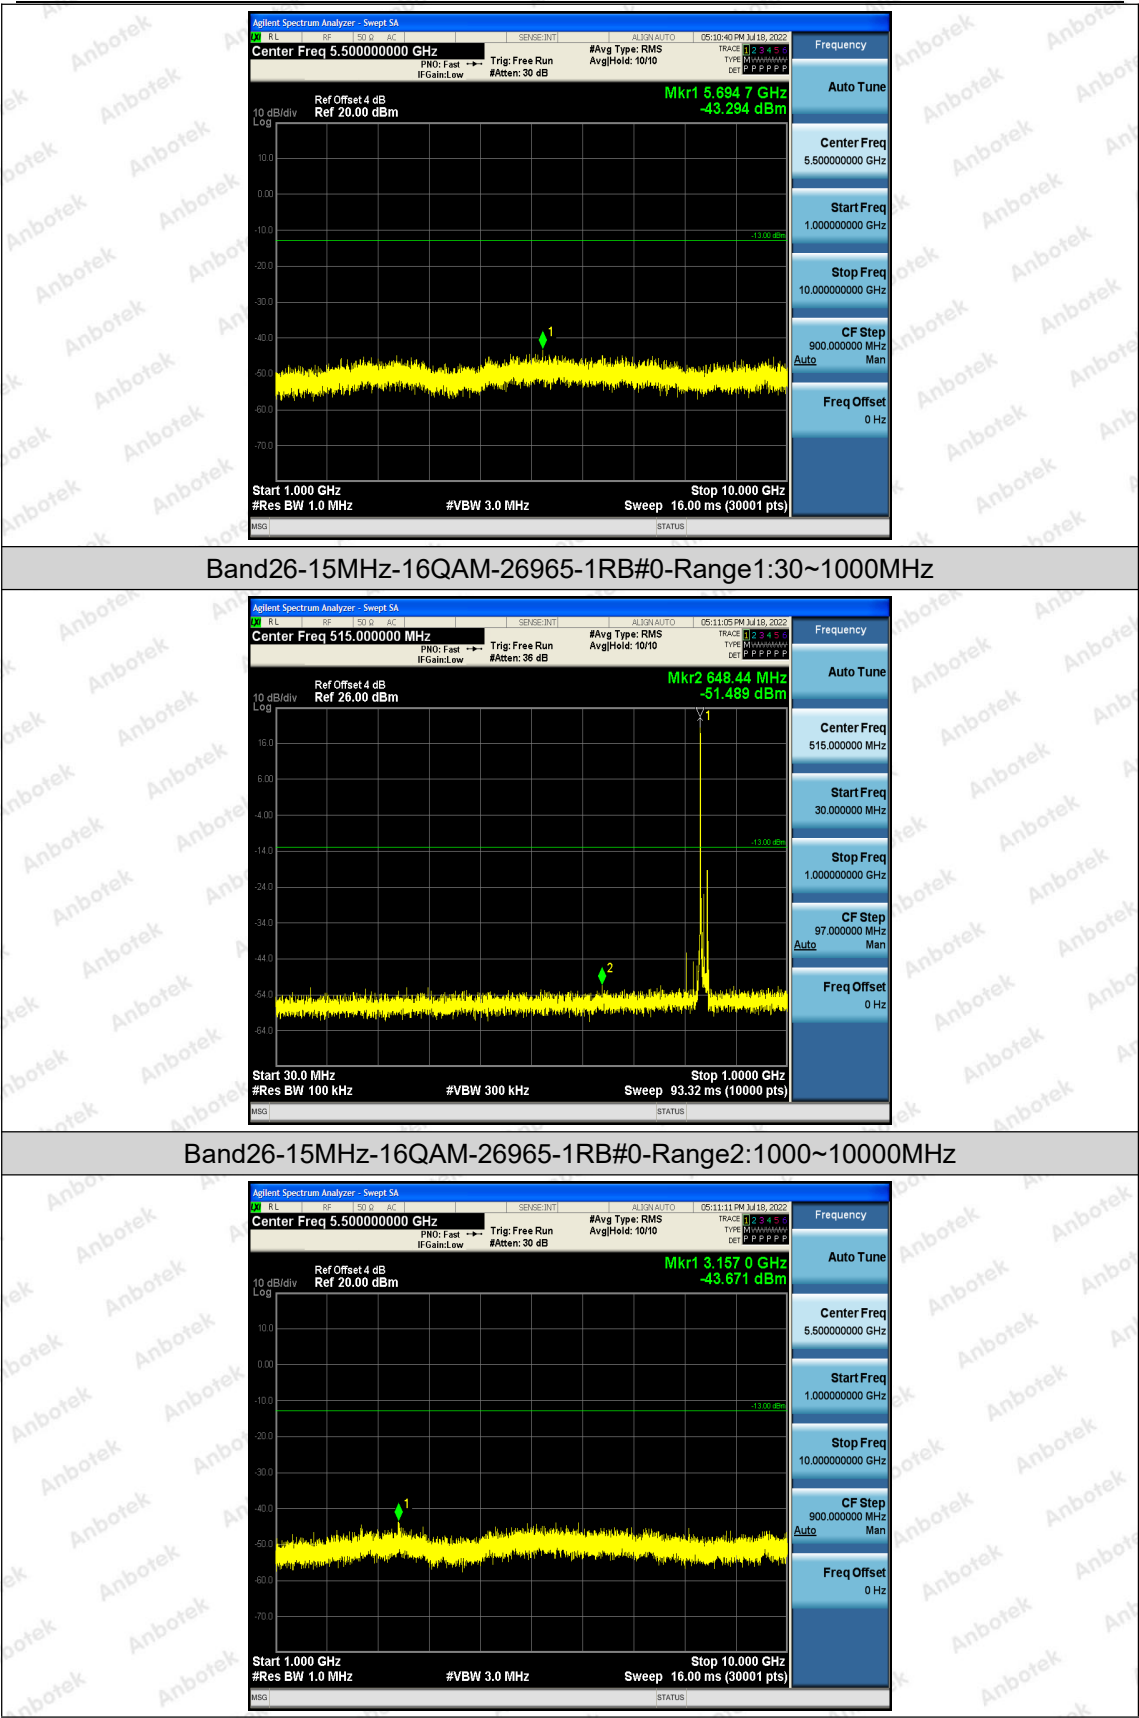

Appendix F: Frequency stability VS Voltage measurement

Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	-6.42	-0.003469	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	-5.68	-0.003069	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	-6.48	-0.003501	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	-5.18	-0.002755	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	-5.32	-0.002830	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	-7.17	-0.003814	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	-4.05	-0.002121	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	-3.99	-0.002090	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	-3.23	-0.001692	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	-5.44	-0.002939	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	-4.99	-0.002696	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	-7.64	-0.004128	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	-6.24	-0.003319	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	-6.45	-0.003431	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	-7.14	-0.003798	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	-3.12	-0.001634	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	-2.56	-0.001341	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	-2.16	-0.001131	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	-4.88	-0.002636	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VN	NT	-4.41	-0.002382	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	-5.45	-0.002944	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	-7.48	-0.003979	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	-4.58	-0.002436	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	-5.97	-0.003176	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	-5.89	-0.003086	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	3.45	0.001808	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	3.15	0.001651	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	3.12	0.001685	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	-6.24	-0.003370	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	-6.18	-0.003338	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	-5.75	-0.003059	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	-9.44	-0.005021	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	-5.75	-0.003059	±2.5	PASS

Band2	3MHz	16QAM	19185	15RB#0	VL	NT	-4.42	-0.002316	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VN	NT	4.29	0.002248	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VH	NT	-5.81	-0.003044	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	-6.55	-0.003536	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	-6.58	-0.003552	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	-2.37	-0.001279	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	-5.66	-0.003011	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	-5.49	-0.002920	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	-6.17	-0.003282	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	-4.73	-0.002480	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	3.62	0.001898	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	3.71	0.001945	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	-5.34	-0.002883	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VN	NT	-5.76	-0.003109	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	-4.62	-0.002494	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	-6.32	-0.003362	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	-7.77	-0.004133	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	-5.81	-0.003090	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	2.92	0.001531	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	3.72	0.001950	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	-2.20	-0.001153	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	-5.22	-0.002814	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	-7.27	-0.003919	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	-4.15	-0.002237	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	-6.58	-0.003500	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VN	NT	-10.70	-0.005691	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	-6.77	-0.003601	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	-2.15	-0.001129	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	-4.71	-0.002472	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	3.81	0.002000	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VL	NT	-5.01	-0.002701	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VN	NT	-4.16	-0.002243	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VH	NT	-5.89	-0.003175	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VL	NT	-9.81	-0.005218	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VN	NT	-5.84	-0.003106	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VH	NT	-6.01	-0.003197	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VL	NT	4.09	0.002147	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VN	NT	4.59	0.002409	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VH	NT	4.78	0.002509	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	-6.98	-0.003758	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	-4.88	-0.002627	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band2	15MHz	QPSK	18675	75RB#0	VH	NT	-8.40	-0.004522	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VL	NT	-5.88	-0.003128	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	-4.53	-0.002410	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	-6.32	-0.003362	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	-6.92	-0.003637	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	-2.47	-0.001298	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	-5.66	-0.002975	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VL	NT	-4.91	-0.002643	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VN	NT	-6.68	-0.003596	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VH	NT	-7.35	-0.003957	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VL	NT	-6.47	-0.003441	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VN	NT	-7.48	-0.003979	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VH	NT	-6.74	-0.003585	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VL	NT	-8.63	-0.004536	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VN	NT	-5.64	-0.002965	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VH	NT	-8.25	-0.004336	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VL	NT	5.12	0.002753	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VN	NT	3.30	0.001774	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VH	NT	-4.22	-0.002269	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VL	NT	-4.96	-0.002638	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	-6.41	-0.003410	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VH	NT	-5.22	-0.002777	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VL	NT	-5.71	-0.003005	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VN	NT	-7.30	-0.003842	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VH	NT	-5.18	-0.002726	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VL	NT	3.98	0.002140	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VN	NT	5.62	0.003022	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VH	NT	4.95	0.002661	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VL	NT	-6.07	-0.003229	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VN	NT	-7.81	-0.004154	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VH	NT	-5.39	-0.002867	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VL	NT	-5.05	-0.002658	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VN	NT	-6.04	-0.003179	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VH	NT	-5.51	-0.002900	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	VL	NT	3.71	0.002169	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	VN	NT	2.10	0.001228	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	VH	NT	3.92	0.002291	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VL	NT	-4.05	-0.002338	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VN	NT	-3.53	-0.002038	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VH	NT	-2.96	-0.001709	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VL	NT	-5.25	-0.002993	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band4	1.4MHz	QPSK	20393	6RB#0	VN	NT	-7.45	-0.004247	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VH	NT	-4.66	-0.002656	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VL	NT	4.05	0.002367	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VN	NT	-2.42	-0.001415	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VH	NT	5.14	0.003005	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VL	NT	4.96	0.002863	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VN	NT	3.56	0.002055	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VH	NT	-2.92	-0.001685	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VL	NT	-7.08	-0.004036	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VN	NT	-5.82	-0.003318	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VH	NT	-7.94	-0.004526	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VL	NT	3.75	0.002191	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VN	NT	4.22	0.002466	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VH	NT	4.35	0.002542	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VL	NT	3.33	0.001922	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VN	NT	2.86	0.001651	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VH	NT	-2.59	-0.001495	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VL	NT	-3.50	-0.001996	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VN	NT	-4.42	-0.002521	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VH	NT	2.13	0.001215	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VL	NT	3.49	0.002039	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VN	NT	2.15	0.001256	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VH	NT	-4.05	-0.002366	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VL	NT	3.78	0.002182	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VN	NT	3.00	0.001732	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VH	NT	2.65	0.001530	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	VL	NT	2.55	0.001454	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	VN	NT	6.37	0.003633	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	VH	NT	-1.79	-0.001021	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VL	NT	4.43	0.002587	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VN	NT	3.63	0.002120	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VH	NT	4.21	0.002458	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VL	NT	-2.07	-0.001195	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VN	NT	2.75	0.001587	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VH	NT	4.08	0.002355	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VL	NT	-6.52	-0.003720	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VN	NT	-6.65	-0.003795	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VH	NT	-8.44	-0.004816	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VL	NT	-3.62	-0.002114	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VN	NT	3.43	0.002003	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VH	NT	5.61	0.003276	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band4	5MHz	16QAM	20175	25RB#0	VL	NT	3.75	0.002165	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VN	NT	3.68	0.002124	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VH	NT	2.79	0.001610	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VL	NT	-6.22	-0.003549	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VN	NT	-3.20	-0.001826	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VH	NT	-7.24	-0.004131	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VL	NT	-6.19	-0.003609	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VN	NT	-4.86	-0.002834	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VH	NT	-7.27	-0.004239	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VL	NT	3.76	0.002170	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VN	NT	3.48	0.002009	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VH	NT	4.82	0.002782	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VL	NT	-2.93	-0.001674	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VN	NT	5.19	0.002966	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VH	NT	2.82	0.001611	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VL	NT	-5.84	-0.003405	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VN	NT	-4.19	-0.002443	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VH	NT	-3.75	-0.002187	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VL	NT	3.73	0.002153	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VN	NT	3.22	0.001859	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VH	NT	3.25	0.001876	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VL	NT	4.75	0.002714	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VN	NT	-4.12	-0.002354	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VH	NT	4.22	0.002411	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	VL	NT	2.53	0.001473	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	VN	NT	4.89	0.002847	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	VH	NT	-4.89	-0.002847	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VL	NT	2.80	0.001616	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VN	NT	3.86	0.002228	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VH	NT	-3.48	-0.002009	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VL	NT	-2.20	-0.001259	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VN	NT	-4.91	-0.002810	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VH	NT	4.49	0.002569	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VL	NT	-4.89	-0.002847	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VN	NT	-4.49	-0.002614	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VH	NT	3.73	0.002172	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VL	NT	3.78	0.002182	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VN	NT	-3.53	-0.002038	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VH	NT	3.49	0.002014	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VL	NT	3.83	0.002192	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VN	NT	3.40	0.001946	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band4	15MHz	16QAM	20325	75RB#0	VH	NT	5.51	0.003153	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VL	NT	3.35	0.001948	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VN	NT	3.85	0.002238	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VH	NT	3.16	0.001837	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VL	NT	4.76	0.002747	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VN	NT	3.32	0.001916	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VH	NT	5.48	0.003163	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VL	NT	-7.75	-0.004441	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VN	NT	-5.62	-0.003221	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VH	NT	-6.77	-0.003880	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VL	NT	3.89	0.002262	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VN	NT	5.58	0.003244	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VH	NT	3.33	0.001936	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VL	NT	3.19	0.001841	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VN	NT	3.92	0.002263	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VH	NT	1.86	0.001074	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VL	NT	-4.41	-0.002527	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VN	NT	-5.87	-0.003364	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VH	NT	-5.38	-0.003083	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	VL	NT	-4.01	-0.004862	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	VN	NT	-3.66	-0.004438	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	VH	NT	-3.72	-0.004511	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	VL	NT	-2.47	-0.002953	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	VN	NT	-3.40	-0.004065	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	VH	NT	-4.11	-0.004913	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	VL	NT	-2.17	-0.002558	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	VN	NT	-2.93	-0.003454	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	VH	NT	3.30	0.003890	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	VL	NT	-4.32	-0.005238	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	VN	NT	-2.02	-0.002449	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	VH	NT	-3.23	-0.003917	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	VL	NT	-2.59	-0.003096	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	VN	NT	-3.78	-0.004519	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	VH	NT	-2.79	-0.003335	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	VL	NT	-2.25	-0.002652	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	VN	NT	-2.69	-0.003171	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	VH	NT	-2.69	-0.003171	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	VL	NT	-4.12	-0.004991	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	VN	NT	-4.68	-0.005669	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	VH	NT	2.37	0.002871	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	VL	NT	-3.99	-0.004770	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band5	3MHz	QPSK	20525	15RB#0	VN	NT	-4.53	-0.005415	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	VH	NT	-2.76	-0.003299	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	VL	NT	-3.05	-0.003599	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	VN	NT	-2.33	-0.002749	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	VH	NT	-4.45	-0.005251	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	VL	NT	3.35	0.004058	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	VN	NT	-2.35	-0.002847	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	VH	NT	2.69	0.003259	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	VL	NT	-2.33	-0.002785	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	VN	NT	1.70	0.002032	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	VH	NT	3.56	0.004256	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	VL	NT	-2.06	-0.002431	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	VN	NT	-3.29	-0.003882	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	VH	NT	-3.23	-0.003811	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	VL	NT	-4.09	-0.004949	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	VN	NT	-3.06	-0.003702	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	VH	NT	-4.16	-0.005033	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	VL	NT	-1.26	-0.001506	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	VN	NT	2.66	0.003180	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	VH	NT	-1.75	-0.002092	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	VL	NT	-2.72	-0.003213	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	VN	NT	2.56	0.003024	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	VH	NT	-3.23	-0.003816	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	VL	NT	-4.53	-0.005481	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	VN	NT	-3.89	-0.004707	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	VH	NT	-3.38	-0.004090	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	VL	NT	-2.96	-0.003539	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	VN	NT	-3.55	-0.004244	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	VH	NT	-3.30	-0.003945	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	VL	NT	2.56	0.003024	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	VN	NT	-2.39	-0.002823	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	VH	NT	-2.55	-0.003012	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	VL	NT	1.85	0.002232	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	VN	NT	-2.05	-0.002473	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	VH	NT	-2.96	-0.003571	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	VL	NT	-2.26	-0.002702	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	VN	NT	1.72	0.002056	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	VH	NT	-3.46	-0.004136	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	VL	NT	-3.12	-0.003697	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	VN	NT	2.55	0.003021	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	VH	NT	-2.42	-0.002867	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band5	10MHz	16QAM	20450	50RB#0	VL	NT	-3.62	-0.004367	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	VN	NT	-3.35	-0.004041	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	VH	NT	-2.69	-0.003245	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	VL	NT	2.22	0.002654	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	VN	NT	-3.10	-0.003706	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	VH	NT	-2.62	-0.003132	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	VL	NT	-5.01	-0.005936	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	VN	NT	-3.66	-0.004336	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	VH	NT	-1.03	-0.001220	±2.5	PASS
Band1 2	1.4MHz	QPSK	23017	6RB#0	VL	NT	-4.11	-0.005874	±2.5	PASS
Band1 2	1.4MHz	QPSK	23017	6RB#0	VN	NT	-2.70	-0.003859	±2.5	PASS
Band1 2	1.4MHz	QPSK	23017	6RB#0	VH	NT	-2.96	-0.004230	±2.5	PASS
Band1 2	1.4MHz	QPSK	23095	6RB#0	VL	NT	-1.86	-0.002629	±2.5	PASS
Band1 2	1.4MHz	QPSK	23095	6RB#0	VN	NT	2.27	0.003208	±2.5	PASS
Band1 2	1.4MHz	QPSK	23095	6RB#0	VH	NT	-4.13	-0.005837	±2.5	PASS
Band1 2	1.4MHz	QPSK	23173	6RB#0	VL	NT	-2.79	-0.003900	±2.5	PASS
Band1 2	1.4MHz	QPSK	23173	6RB#0	VN	NT	-3.18	-0.004446	±2.5	PASS
Band1 2	1.4MHz	QPSK	23173	6RB#0	VH	NT	-3.89	-0.005438	±2.5	PASS
Band1 2	1.4MHz	16QAM	23017	6RB#0	VL	NT	-2.65	-0.003787	±2.5	PASS
Band1 2	1.4MHz	16QAM	23017	6RB#0	VN	NT	-2.69	-0.003845	±2.5	PASS
Band1 2	1.4MHz	16QAM	23017	6RB#0	VH	NT	-3.30	-0.004716	±2.5	PASS
Band1 2	1.4MHz	16QAM	23095	6RB#0	VL	NT	-4.11	-0.005809	±2.5	PASS
Band1 2	1.4MHz	16QAM	23095	6RB#0	VN	NT	2.36	0.003336	±2.5	PASS
Band1 2	1.4MHz	16QAM	23095	6RB#0	VH	NT	-2.86	-0.004042	±2.5	PASS
Band1 2	1.4MHz	16QAM	23173	6RB#0	VL	NT	-3.82	-0.005340	±2.5	PASS
Band1	1.4MHz	16QAM	23173	6RB#0	VN	NT	-1.93	-0.002698	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

2										
Band1 2	1.4MHz	16QAM	23173	6RB#0	VH	NT	1.60	0.002237	±2.5	PASS
Band1 2	3MHz	QPSK	23025	15RB#0	VL	NT	-2.56	-0.003655	±2.5	PASS
Band1 2	3MHz	QPSK	23025	15RB#0	VN	NT	-1.86	-0.002655	±2.5	PASS
Band1 2	3MHz	QPSK	23025	15RB#0	VH	NT	-2.32	-0.003312	±2.5	PASS
Band1 2	3MHz	QPSK	23095	15RB#0	VL	NT	-3.16	-0.004466	±2.5	PASS
Band1 2	3MHz	QPSK	23095	15RB#0	VN	NT	-4.96	-0.007011	±2.5	PASS
Band1 2	3MHz	QPSK	23095	15RB#0	VH	NT	-1.87	-0.002643	±2.5	PASS
Band1 2	3MHz	QPSK	23165	15RB#0	VL	NT	-2.19	-0.003065	±2.5	PASS
Band1 2	3MHz	QPSK	23165	15RB#0	VN	NT	2.73	0.003821	±2.5	PASS
Band1 2	3MHz	QPSK	23165	15RB#0	VH	NT	2.40	0.003359	±2.5	PASS
Band1 2	3MHz	16QAM	23025	15RB#0	VL	NT	2.00	0.002855	±2.5	PASS
Band1 2	3MHz	16QAM	23025	15RB#0	VN	NT	2.99	0.004268	±2.5	PASS
Band1 2	3MHz	16QAM	23025	15RB#0	VH	NT	3.46	0.004939	±2.5	PASS
Band1 2	3MHz	16QAM	23095	15RB#0	VL	NT	-1.76	-0.002488	±2.5	PASS
Band1 2	3MHz	16QAM	23095	15RB#0	VN	NT	-2.20	-0.003110	±2.5	PASS
Band1 2	3MHz	16QAM	23095	15RB#0	VH	NT	-1.39	-0.001965	±2.5	PASS
Band1 2	3MHz	16QAM	23165	15RB#0	VL	NT	-1.40	-0.001959	±2.5	PASS
Band1 2	3MHz	16QAM	23165	15RB#0	VN	NT	-3.12	-0.004367	±2.5	PASS
Band1 2	3MHz	16QAM	23165	15RB#0	VH	NT	-2.93	-0.004101	±2.5	PASS
Band1 2	5MHz	QPSK	23035	25RB#0	VL	NT	-4.46	-0.006358	±2.5	PASS
Band1	5MHz	QPSK	23035	25RB#0	VN	NT	-3.05	-0.004348	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

2										
Band1 2	5MHz	QPSK	23035	25RB#0	VH	NT	-2.83	-0.004034	±2.5	PASS
Band1 2	5MHz	QPSK	23095	25RB#0	VL	NT	-2.66	-0.003760	±2.5	PASS
Band1 2	5MHz	QPSK	23095	25RB#0	VN	NT	-1.57	-0.002219	±2.5	PASS
Band1 2	5MHz	QPSK	23095	25RB#0	VH	NT	-2.22	-0.003138	±2.5	PASS
Band1 2	5MHz	QPSK	23155	25RB#0	VL	NT	2.40	0.003364	±2.5	PASS
Band1 2	5MHz	QPSK	23155	25RB#0	VN	NT	-2.66	-0.003728	±2.5	PASS
Band1 2	5MHz	QPSK	23155	25RB#0	VH	NT	2.57	0.003602	±2.5	PASS
Band1 2	5MHz	16QAM	23035	25RB#0	VL	NT	-2.90	-0.004134	±2.5	PASS
Band1 2	5MHz	16QAM	23035	25RB#0	VN	NT	-3.32	-0.004733	±2.5	PASS
Band1 2	5MHz	16QAM	23035	25RB#0	VH	NT	-4.42	-0.006301	±2.5	PASS
Band1 2	5MHz	16QAM	23095	25RB#0	VL	NT	-1.82	-0.002572	±2.5	PASS
Band1 2	5MHz	16QAM	23095	25RB#0	VN	NT	-2.60	-0.003675	±2.5	PASS
Band1 2	5MHz	16QAM	23095	25RB#0	VH	NT	-3.68	-0.005201	±2.5	PASS
Band1 2	5MHz	16QAM	23155	25RB#0	VL	NT	-4.12	-0.005774	±2.5	PASS
Band1 2	5MHz	16QAM	23155	25RB#0	VN	NT	-3.32	-0.004653	±2.5	PASS
Band1 2	5MHz	16QAM	23155	25RB#0	VH	NT	-3.02	-0.004233	±2.5	PASS
Band1 2	10MHz	QPSK	23060	50RB#0	VL	NT	-2.45	-0.003480	±2.5	PASS
Band1 2	10MHz	QPSK	23060	50RB#0	VN	NT	-1.83	-0.002599	±2.5	PASS
Band1 2	10MHz	QPSK	23060	50RB#0	VH	NT	-3.09	-0.004389	±2.5	PASS
Band1 2	10MHz	QPSK	23095	50RB#0	VL	NT	-4.12	-0.005823	±2.5	PASS
Band1	10MHz	QPSK	23095	50RB#0	VN	NT	-3.75	-0.005300	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

2										
Band1 2	10MHz	QPSK	23095	50RB#0	VH	NT	-3.15	-0.004452	±2.5	PASS
Band1 2	10MHz	QPSK	23130	50RB#0	VL	NT	-4.33	-0.006090	±2.5	PASS
Band1 2	10MHz	QPSK	23130	50RB#0	VN	NT	-3.73	-0.005246	±2.5	PASS
Band1 2	10MHz	QPSK	23130	50RB#0	VH	NT	-5.26	-0.007398	±2.5	PASS
Band1 2	10MHz	16QAM	23060	50RB#0	VL	NT	2.37	0.003366	±2.5	PASS
Band1 2	10MHz	16QAM	23060	50RB#0	VN	NT	2.00	0.002841	±2.5	PASS
Band1 2	10MHz	16QAM	23060	50RB#0	VH	NT	1.22	0.001733	±2.5	PASS
Band1 2	10MHz	16QAM	23095	50RB#0	VL	NT	3.02	0.004269	±2.5	PASS
Band1 2	10MHz	16QAM	23095	50RB#0	VN	NT	3.20	0.004523	±2.5	PASS
Band1 2	10MHz	16QAM	23095	50RB#0	VH	NT	1.86	0.002629	±2.5	PASS
Band1 2	10MHz	16QAM	23130	50RB#0	VL	NT	-4.09	-0.005752	±2.5	PASS
Band1 2	10MHz	16QAM	23130	50RB#0	VN	NT	-2.40	-0.003376	±2.5	PASS
Band1 2	10MHz	16QAM	23130	50RB#0	VH	NT	-3.22	-0.004529	±2.5	PASS
Band1 3	5MHz	QPSK	23205	25RB#0	VL	NT	-4.48	-0.005747	±2.5	PASS
Band1 3	5MHz	QPSK	23205	25RB#0	VN	NT	-2.39	-0.003066	±2.5	PASS
Band1 3	5MHz	QPSK	23205	25RB#0	VH	NT	-2.86	-0.003669	±2.5	PASS
Band1 3	5MHz	QPSK	23230	25RB#0	VL	NT	-1.70	-0.002174	±2.5	PASS
Band1 3	5MHz	QPSK	23230	25RB#0	VN	NT	2.46	0.003146	±2.5	PASS
Band1 3	5MHz	QPSK	23230	25RB#0	VH	NT	-3.40	-0.004348	±2.5	PASS
Band1 3	5MHz	QPSK	23255	25RB#0	VL	NT	-1.46	-0.001861	±2.5	PASS
Band1	5MHz	QPSK	23255	25RB#0	VN	NT	-4.35	-0.005545	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

3										
Band1 3	5MHz	QPSK	23255	25RB#0	VH	NT	-3.35	-0.004270	±2.5	PASS
Band1 3	5MHz	16QAM	23205	25RB#0	VL	NT	-4.49	-0.005760	±2.5	PASS
Band1 3	5MHz	16QAM	23205	25RB#0	VN	NT	-2.90	-0.003720	±2.5	PASS
Band1 3	5MHz	16QAM	23205	25RB#0	VH	NT	-2.83	-0.003631	±2.5	PASS
Band1 3	5MHz	16QAM	23230	25RB#0	VL	NT	-3.76	-0.004808	±2.5	PASS
Band1 3	5MHz	16QAM	23230	25RB#0	VN	NT	-2.37	-0.003031	±2.5	PASS
Band1 3	5MHz	16QAM	23230	25RB#0	VH	NT	-3.22	-0.004118	±2.5	PASS
Band1 3	5MHz	16QAM	23255	25RB#0	VL	NT	-3.50	-0.004461	±2.5	PASS
Band1 3	5MHz	16QAM	23255	25RB#0	VN	NT	3.40	0.004334	±2.5	PASS
Band1 3	5MHz	16QAM	23255	25RB#0	VH	NT	-3.69	-0.004704	±2.5	PASS
Band1 3	10MHz	QPSK	23230	50RB#0	VL	NT	-1.70	-0.002174	±2.5	PASS
Band1 3	10MHz	QPSK	23230	50RB#0	VN	NT	-3.19	-0.004079	±2.5	PASS
Band1 3	10MHz	QPSK	23230	50RB#0	VH	NT	-3.10	-0.003964	±2.5	PASS
Band1 3	10MHz	16QAM	23230	50RB#0	VL	NT	-2.50	-0.003197	±2.5	PASS
Band1 3	10MHz	16QAM	23230	50RB#0	VN	NT	2.17	0.002775	±2.5	PASS
Band1 3	10MHz	16QAM	23230	50RB#0	VH	NT	1.82	0.002327	±2.5	PASS
Band2 5	1.4MHz	QPSK	26047	6RB#0	VL	NT	-5.25	-0.002837	±2.5	PASS
Band2 5	1.4MHz	QPSK	26047	6RB#0	VN	NT	-6.38	-0.003447	±2.5	PASS
Band2 5	1.4MHz	QPSK	26047	6RB#0	VH	NT	-4.51	-0.002437	±2.5	PASS
Band2 5	1.4MHz	QPSK	26365	6RB#0	VL	NT	4.02	0.002135	±2.5	PASS
Band2	1.4MHz	QPSK	26365	6RB#0	VN	NT	2.52	0.001339	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

5										
Band2 5	1.4MHz	QPSK	26365	6RB#0	VH	NT	4.19	0.002226	±2.5	PASS
Band2 5	1.4MHz	QPSK	26683	6RB#0	VL	NT	-6.75	-0.003526	±2.5	PASS
Band2 5	1.4MHz	QPSK	26683	6RB#0	VN	NT	-7.52	-0.003928	±2.5	PASS
Band2 5	1.4MHz	QPSK	26683	6RB#0	VH	NT	-7.82	-0.004085	±2.5	PASS
Band2 5	1.4MHz	16QAM	26047	6RB#0	VL	NT	-3.23	-0.001745	±2.5	PASS
Band2 5	1.4MHz	16QAM	26047	6RB#0	VN	NT	-4.94	-0.002669	±2.5	PASS
Band2 5	1.4MHz	16QAM	26047	6RB#0	VH	NT	-3.86	-0.002086	±2.5	PASS
Band2 5	1.4MHz	16QAM	26365	6RB#0	VL	NT	-5.11	-0.002714	±2.5	PASS
Band2 5	1.4MHz	16QAM	26365	6RB#0	VN	NT	3.76	0.001997	±2.5	PASS
Band2 5	1.4MHz	16QAM	26365	6RB#0	VH	NT	6.14	0.003262	±2.5	PASS
Band2 5	1.4MHz	16QAM	26683	6RB#0	VL	NT	-3.71	-0.001938	±2.5	PASS
Band2 5	1.4MHz	16QAM	26683	6RB#0	VN	NT	-4.11	-0.002147	±2.5	PASS
Band2 5	1.4MHz	16QAM	26683	6RB#0	VH	NT	-6.38	-0.003333	±2.5	PASS
Band2 5	3MHz	QPSK	26055	15RB#0	VL	NT	-4.85	-0.002619	±2.5	PASS
Band2 5	3MHz	QPSK	26055	15RB#0	VN	NT	-5.52	-0.002981	±2.5	PASS
Band2 5	3MHz	QPSK	26055	15RB#0	VH	NT	-5.81	-0.003138	±2.5	PASS
Band2 5	3MHz	QPSK	26365	15RB#0	VL	NT	-4.62	-0.002454	±2.5	PASS
Band2 5	3MHz	QPSK	26365	15RB#0	VN	NT	2.93	0.001556	±2.5	PASS
Band2 5	3MHz	QPSK	26365	15RB#0	VH	NT	-3.42	-0.001817	±2.5	PASS
Band2 5	3MHz	QPSK	26675	15RB#0	VL	NT	-3.33	-0.001740	±2.5	PASS
Band2	3MHz	QPSK	26675	15RB#0	VN	NT	-5.26	-0.002749	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

5										
Band2 5	3MHz	QPSK	26675	15RB#0	VH	NT	-5.56	-0.002906	±2.5	PASS
Band2 5	3MHz	16QAM	26055	15RB#0	VL	NT	-8.14	-0.004396	±2.5	PASS
Band2 5	3MHz	16QAM	26055	15RB#0	VN	NT	-6.08	-0.003284	±2.5	PASS
Band2 5	3MHz	16QAM	26055	15RB#0	VH	NT	-4.65	-0.002511	±2.5	PASS
Band2 5	3MHz	16QAM	26365	15RB#0	VL	NT	4.03	0.002141	±2.5	PASS
Band2 5	3MHz	16QAM	26365	15RB#0	VN	NT	4.86	0.002582	±2.5	PASS
Band2 5	3MHz	16QAM	26365	15RB#0	VH	NT	4.11	0.002183	±2.5	PASS
Band2 5	3MHz	16QAM	26675	15RB#0	VL	NT	-4.98	-0.002603	±2.5	PASS
Band2 5	3MHz	16QAM	26675	15RB#0	VN	NT	-3.62	-0.001892	±2.5	PASS
Band2 5	3MHz	16QAM	26675	15RB#0	VH	NT	-8.53	-0.004458	±2.5	PASS
Band2 5	5MHz	QPSK	26065	25RB#0	VL	NT	-7.11	-0.003838	±2.5	PASS
Band2 5	5MHz	QPSK	26065	25RB#0	VN	NT	-3.33	-0.001798	±2.5	PASS
Band2 5	5MHz	QPSK	26065	25RB#0	VH	NT	-7.97	-0.004302	±2.5	PASS
Band2 5	5MHz	QPSK	26365	25RB#0	VL	NT	3.49	0.001854	±2.5	PASS
Band2 5	5MHz	QPSK	26365	25RB#0	VN	NT	3.08	0.001636	±2.5	PASS
Band2 5	5MHz	QPSK	26365	25RB#0	VH	NT	4.03	0.002141	±2.5	PASS
Band2 5	5MHz	QPSK	26665	25RB#0	VL	NT	-3.71	-0.001940	±2.5	PASS
Band2 5	5MHz	QPSK	26665	25RB#0	VN	NT	-6.02	-0.003148	±2.5	PASS
Band2 5	5MHz	QPSK	26665	25RB#0	VH	NT	-5.54	-0.002897	±2.5	PASS
Band2 5	5MHz	16QAM	26065	25RB#0	VL	NT	-6.01	-0.003244	±2.5	PASS
Band2	5MHz	16QAM	26065	25RB#0	VN	NT	-4.75	-0.002564	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

5										
Band2 5	5MHz	16QAM	26065	25RB#0	VH	NT	-5.41	-0.002920	±2.5	PASS
Band2 5	5MHz	16QAM	26365	25RB#0	VL	NT	-4.33	-0.002300	±2.5	PASS
Band2 5	5MHz	16QAM	26365	25RB#0	VN	NT	-1.69	-0.000898	±2.5	PASS
Band2 5	5MHz	16QAM	26365	25RB#0	VH	NT	3.19	0.001695	±2.5	PASS
Band2 5	5MHz	16QAM	26665	25RB#0	VL	NT	-7.51	-0.003927	±2.5	PASS
Band2 5	5MHz	16QAM	26665	25RB#0	VN	NT	-7.28	-0.003807	±2.5	PASS
Band2 5	5MHz	16QAM	26665	25RB#0	VH	NT	-7.15	-0.003739	±2.5	PASS
Band2 5	10MHz	QPSK	26090	50RB#0	VL	NT	-4.61	-0.002485	±2.5	PASS
Band2 5	10MHz	QPSK	26090	50RB#0	VN	NT	-5.34	-0.002879	±2.5	PASS
Band2 5	10MHz	QPSK	26090	50RB#0	VH	NT	-4.46	-0.002404	±2.5	PASS
Band2 5	10MHz	QPSK	26365	50RB#0	VL	NT	2.86	0.001519	±2.5	PASS
Band2 5	10MHz	QPSK	26365	50RB#0	VN	NT	5.16	0.002741	±2.5	PASS
Band2 5	10MHz	QPSK	26365	50RB#0	VH	NT	-2.78	-0.001477	±2.5	PASS
Band2 5	10MHz	QPSK	26640	50RB#0	VL	NT	-5.15	-0.002696	±2.5	PASS
Band2 5	10MHz	QPSK	26640	50RB#0	VN	NT	-4.66	-0.002440	±2.5	PASS
Band2 5	10MHz	QPSK	26640	50RB#0	VH	NT	-2.85	-0.001492	±2.5	PASS
Band2 5	10MHz	16QAM	26090	50RB#0	VL	NT	-4.06	-0.002189	±2.5	PASS
Band2 5	10MHz	16QAM	26090	50RB#0	VN	NT	-4.51	-0.002431	±2.5	PASS
Band2 5	10MHz	16QAM	26090	50RB#0	VH	NT	-2.53	-0.001364	±2.5	PASS
Band2 5	10MHz	16QAM	26365	50RB#0	VL	NT	5.82	0.003092	±2.5	PASS
Band2	10MHz	16QAM	26365	50RB#0	VN	NT	3.30	0.001753	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

5										
Band2 5	10MHz	16QAM	26365	50RB#0	VH	NT	3.45	0.001833	±2.5	PASS
Band2 5	10MHz	16QAM	26640	50RB#0	VL	NT	-6.72	-0.003518	±2.5	PASS
Band2 5	10MHz	16QAM	26640	50RB#0	VN	NT	-4.42	-0.002314	±2.5	PASS
Band2 5	10MHz	16QAM	26640	50RB#0	VH	NT	-5.18	-0.002712	±2.5	PASS
Band2 5	15MHz	QPSK	26115	75RB#0	VL	NT	-7.52	-0.004048	±2.5	PASS
Band2 5	15MHz	QPSK	26115	75RB#0	VN	NT	-8.67	-0.004668	±2.5	PASS
Band2 5	15MHz	QPSK	26115	75RB#0	VH	NT	-5.41	-0.002913	±2.5	PASS
Band2 5	15MHz	QPSK	26365	75RB#0	VL	NT	2.96	0.001572	±2.5	PASS
Band2 5	15MHz	QPSK	26365	75RB#0	VN	NT	2.82	0.001498	±2.5	PASS
Band2 5	15MHz	QPSK	26365	75RB#0	VH	NT	5.79	0.003076	±2.5	PASS
Band2 5	15MHz	QPSK	26615	75RB#0	VL	NT	-3.73	-0.001955	±2.5	PASS
Band2 5	15MHz	QPSK	26615	75RB#0	VN	NT	4.08	0.002139	±2.5	PASS
Band2 5	15MHz	QPSK	26615	75RB#0	VH	NT	3.91	0.002050	±2.5	PASS
Band2 5	15MHz	16QAM	26115	75RB#0	VL	NT	-8.33	-0.004485	±2.5	PASS
Band2 5	15MHz	16QAM	26115	75RB#0	VN	NT	-6.57	-0.003537	±2.5	PASS
Band2 5	15MHz	16QAM	26115	75RB#0	VH	NT	-8.60	-0.004630	±2.5	PASS
Band2 5	15MHz	16QAM	26365	75RB#0	VL	NT	-3.76	-0.001997	±2.5	PASS
Band2 5	15MHz	16QAM	26365	75RB#0	VN	NT	4.12	0.002189	±2.5	PASS
Band2 5	15MHz	16QAM	26365	75RB#0	VH	NT	4.25	0.002258	±2.5	PASS
Band2 5	15MHz	16QAM	26615	75RB#0	VL	NT	6.11	0.003203	±2.5	PASS
Band2	15MHz	16QAM	26615	75RB#0	VN	NT	4.29	0.002249	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

5										
Band2 5	15MHz	16QAM	26615	75RB#0	VH	NT	3.18	0.001667	±2.5	PASS
Band2 5	20MHz	QPSK	26140	100RB#0	VL	NT	-2.79	-0.001500	±2.5	PASS
Band2 5	20MHz	QPSK	26140	100RB#0	VN	NT	7.42	0.003989	±2.5	PASS
Band2 5	20MHz	QPSK	26140	100RB#0	VH	NT	-3.88	-0.002086	±2.5	PASS
Band2 5	20MHz	QPSK	26365	100RB#0	VL	NT	3.12	0.001657	±2.5	PASS
Band2 5	20MHz	QPSK	26365	100RB#0	VN	NT	5.02	0.002667	±2.5	PASS
Band2 5	20MHz	QPSK	26365	100RB#0	VH	NT	4.42	0.002348	±2.5	PASS
Band2 5	20MHz	QPSK	26590	100RB#0	VL	NT	6.32	0.003318	±2.5	PASS
Band2 5	20MHz	QPSK	26590	100RB#0	VN	NT	-3.63	-0.001906	±2.5	PASS
Band2 5	20MHz	QPSK	26590	100RB#0	VH	NT	5.05	0.002651	±2.5	PASS
Band2 5	20MHz	16QAM	26140	100RB#0	VL	NT	-4.66	-0.002505	±2.5	PASS
Band2 5	20MHz	16QAM	26140	100RB#0	VN	NT	2.68	0.001441	±2.5	PASS
Band2 5	20MHz	16QAM	26140	100RB#0	VH	NT	2.09	0.001124	±2.5	PASS
Band2 5	20MHz	16QAM	26365	100RB#0	VL	NT	3.96	0.002104	±2.5	PASS
Band2 5	20MHz	16QAM	26365	100RB#0	VN	NT	3.73	0.001981	±2.5	PASS
Band2 5	20MHz	16QAM	26365	100RB#0	VH	NT	6.18	0.003283	±2.5	PASS
Band2 5	20MHz	16QAM	26590	100RB#0	VL	NT	7.28	0.003822	±2.5	PASS
Band2 5	20MHz	16QAM	26590	100RB#0	VN	NT	3.50	0.001837	±2.5	PASS
Band2 5	20MHz	16QAM	26590	100RB#0	VH	NT	5.98	0.003139	±2.5	PASS
Band2 6	1.4MHz	QPSK	26797	6RB#0	VL	NT	-3.81	-0.004620	±2.5	PASS
Band2	1.4MHz	QPSK	26797	6RB#0	VN	NT	-2.78	-0.003371	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

6										
Band2 6	1.4MHz	QPSK	26797	6RB#0	VH	NT	-4.49	-0.005444	±2.5	PASS
Band2 6	1.4MHz	QPSK	26915	6RB#0	VL	NT	-2.73	-0.003264	±2.5	PASS
Band2 6	1.4MHz	QPSK	26915	6RB#0	VN	NT	-4.11	-0.004913	±2.5	PASS
Band2 6	1.4MHz	QPSK	26915	6RB#0	VH	NT	-3.66	-0.004375	±2.5	PASS
Band2 6	1.4MHz	QPSK	27033	6RB#0	VL	NT	3.05	0.003595	±2.5	PASS
Band2 6	1.4MHz	QPSK	27033	6RB#0	VN	NT	-2.55	-0.003006	±2.5	PASS
Band2 6	1.4MHz	QPSK	27033	6RB#0	VH	NT	-2.65	-0.003124	±2.5	PASS
Band2 6	1.4MHz	16QAM	26797	6RB#0	VL	NT	-5.92	-0.007178	±2.5	PASS
Band2 6	1.4MHz	16QAM	26797	6RB#0	VN	NT	-1.09	-0.001322	±2.5	PASS
Band2 6	1.4MHz	16QAM	26797	6RB#0	VH	NT	-4.09	-0.004959	±2.5	PASS
Band2 6	1.4MHz	16QAM	26915	6RB#0	VL	NT	-3.39	-0.004053	±2.5	PASS
Band2 6	1.4MHz	16QAM	26915	6RB#0	VN	NT	-2.83	-0.003383	±2.5	PASS
Band2 6	1.4MHz	16QAM	26915	6RB#0	VH	NT	-2.06	-0.002463	±2.5	PASS
Band2 6	1.4MHz	16QAM	27033	6RB#0	VL	NT	2.93	0.003454	±2.5	PASS
Band2 6	1.4MHz	16QAM	27033	6RB#0	VN	NT	-2.26	-0.002664	±2.5	PASS
Band2 6	1.4MHz	16QAM	27033	6RB#0	VH	NT	-1.83	-0.002157	±2.5	PASS
Band2 6	3MHz	QPSK	26805	15RB#0	VL	NT	-3.22	-0.003901	±2.5	PASS
Band2 6	3MHz	QPSK	26805	15RB#0	VN	NT	-1.76	-0.002132	±2.5	PASS
Band2 6	3MHz	QPSK	26805	15RB#0	VH	NT	-2.32	-0.002810	±2.5	PASS
Band2 6	3MHz	QPSK	26915	15RB#0	VL	NT	0.86	0.001028	±2.5	PASS
Band2	3MHz	QPSK	26915	15RB#0	VN	NT	-3.65	-0.004363	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

6										
Band2 6	3MHz	QPSK	26915	15RB#0	VH	NT	-3.78	-0.004519	±2.5	PASS
Band2 6	3MHz	QPSK	27025	15RB#0	VL	NT	-4.36	-0.005145	±2.5	PASS
Band2 6	3MHz	QPSK	27025	15RB#0	VN	NT	-1.43	-0.001687	±2.5	PASS
Band2 6	3MHz	QPSK	27025	15RB#0	VH	NT	-4.98	-0.005876	±2.5	PASS
Band2 6	3MHz	16QAM	26805	15RB#0	VL	NT	1.62	0.001962	±2.5	PASS
Band2 6	3MHz	16QAM	26805	15RB#0	VN	NT	2.59	0.003137	±2.5	PASS
Band2 6	3MHz	16QAM	26805	15RB#0	VH	NT	-2.32	-0.002810	±2.5	PASS
Band2 6	3MHz	16QAM	26915	15RB#0	VL	NT	-2.83	-0.003383	±2.5	PASS
Band2 6	3MHz	16QAM	26915	15RB#0	VN	NT	2.12	0.002534	±2.5	PASS
Band2 6	3MHz	16QAM	26915	15RB#0	VH	NT	2.50	0.002989	±2.5	PASS
Band2 6	3MHz	16QAM	27025	15RB#0	VL	NT	-4.95	-0.005841	±2.5	PASS
Band2 6	3MHz	16QAM	27025	15RB#0	VN	NT	-2.76	-0.003257	±2.5	PASS
Band2 6	3MHz	16QAM	27025	15RB#0	VH	NT	-4.08	-0.004814	±2.5	PASS
Band2 6	5MHz	QPSK	26815	25RB#0	VL	NT	-2.65	-0.003206	±2.5	PASS
Band2 6	5MHz	QPSK	26815	25RB#0	VN	NT	-4.71	-0.005699	±2.5	PASS
Band2 6	5MHz	QPSK	26815	25RB#0	VH	NT	-4.42	-0.005348	±2.5	PASS
Band2 6	5MHz	QPSK	26915	25RB#0	VL	NT	-4.15	-0.004961	±2.5	PASS
Band2 6	5MHz	QPSK	26915	25RB#0	VN	NT	-2.46	-0.002941	±2.5	PASS
Band2 6	5MHz	QPSK	26915	25RB#0	VH	NT	-2.76	-0.003299	±2.5	PASS
Band2 6	5MHz	QPSK	27015	25RB#0	VL	NT	-1.83	-0.002162	±2.5	PASS
Band2 6	5MHz	QPSK	27015	25RB#0	VN	NT	-2.63	-0.003107	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

6										
Band2 6	5MHz	QPSK	27015	25RB#0	VH	NT	-3.06	-0.003615	±2.5	PASS
Band2 6	5MHz	16QAM	26815	25RB#0	VL	NT	-1.80	-0.002178	±2.5	PASS
Band2 6	5MHz	16QAM	26815	25RB#0	VN	NT	-4.55	-0.005505	±2.5	PASS
Band2 6	5MHz	16QAM	26815	25RB#0	VH	NT	-3.42	-0.004138	±2.5	PASS
Band2 6	5MHz	16QAM	26915	25RB#0	VL	NT	-2.63	-0.003144	±2.5	PASS
Band2 6	5MHz	16QAM	26915	25RB#0	VN	NT	-3.39	-0.004053	±2.5	PASS
Band2 6	5MHz	16QAM	26915	25RB#0	VH	NT	-3.69	-0.004411	±2.5	PASS
Band2 6	5MHz	16QAM	27015	25RB#0	VL	NT	2.09	0.002469	±2.5	PASS
Band2 6	5MHz	16QAM	27015	25RB#0	VN	NT	2.06	0.002434	±2.5	PASS
Band2 6	5MHz	16QAM	27015	25RB#0	VH	NT	-2.29	-0.002705	±2.5	PASS
Band2 6	10MHz	QPSK	26840	50RB#0	VL	NT	-1.59	-0.001918	±2.5	PASS
Band2 6	10MHz	QPSK	26840	50RB#0	VN	NT	1.65	0.001990	±2.5	PASS
Band2 6	10MHz	QPSK	26840	50RB#0	VH	NT	-2.13	-0.002569	±2.5	PASS
Band2 6	10MHz	QPSK	26915	50RB#0	VL	NT	-2.70	-0.003228	±2.5	PASS
Band2 6	10MHz	QPSK	26915	50RB#0	VN	NT	-2.53	-0.003025	±2.5	PASS
Band2 6	10MHz	QPSK	26915	50RB#0	VH	NT	-2.69	-0.003216	±2.5	PASS
Band2 6	10MHz	QPSK	26990	50RB#0	VL	NT	3.08	0.003649	±2.5	PASS
Band2 6	10MHz	QPSK	26990	50RB#0	VN	NT	-1.85	-0.002192	±2.5	PASS
Band2 6	10MHz	QPSK	26990	50RB#0	VH	NT	-4.22	-0.005000	±2.5	PASS
Band2 6	10MHz	16QAM	26840	50RB#0	VL	NT	-1.87	-0.002256	±2.5	PASS
Band2	10MHz	16QAM	26840	50RB#0	VN	NT	4.78	0.005766	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

6										
Band2 6	10MHz	16QAM	26840	50RB#0	VH	NT	2.09	0.002521	±2.5	PASS
Band2 6	10MHz	16QAM	26915	50RB#0	VL	NT	1.54	0.001841	±2.5	PASS
Band2 6	10MHz	16QAM	26915	50RB#0	VN	NT	-2.86	-0.003419	±2.5	PASS
Band2 6	10MHz	16QAM	26915	50RB#0	VH	NT	-2.62	-0.003132	±2.5	PASS
Band2 6	10MHz	16QAM	26990	50RB#0	VL	NT	-2.30	-0.002725	±2.5	PASS
Band2 6	10MHz	16QAM	26990	50RB#0	VN	NT	-2.03	-0.002405	±2.5	PASS
Band2 6	10MHz	16QAM	26990	50RB#0	VH	NT	-1.87	-0.002216	±2.5	PASS
Band2 6	15MHz	QPSK	26865	75RB#0	VL	NT	2.13	0.002562	±2.5	PASS
Band2 6	15MHz	QPSK	26865	75RB#0	VN	NT	-2.55	-0.003067	±2.5	PASS
Band2 6	15MHz	QPSK	26865	75RB#0	VH	NT	3.25	0.003909	±2.5	PASS
Band2 6	15MHz	QPSK	26915	75RB#0	VL	NT	-3.82	-0.004567	±2.5	PASS
Band2 6	15MHz	QPSK	26915	75RB#0	VN	NT	-2.72	-0.003252	±2.5	PASS
Band2 6	15MHz	QPSK	26915	75RB#0	VH	NT	-2.78	-0.003323	±2.5	PASS
Band2 6	15MHz	QPSK	26965	75RB#0	VL	NT	-2.93	-0.003482	±2.5	PASS
Band2 6	15MHz	QPSK	26965	75RB#0	VN	NT	-4.31	-0.005122	±2.5	PASS
Band2 6	15MHz	QPSK	26965	75RB#0	VH	NT	-4.41	-0.005241	±2.5	PASS
Band2 6	15MHz	16QAM	26865	75RB#0	VL	NT	-2.55	-0.003067	±2.5	PASS
Band2 6	15MHz	16QAM	26865	75RB#0	VN	NT	-2.82	-0.003391	±2.5	PASS
Band2 6	15MHz	16QAM	26865	75RB#0	VH	NT	-2.98	-0.003584	±2.5	PASS
Band2 6	15MHz	16QAM	26915	75RB#0	VL	NT	-1.77	-0.002116	±2.5	PASS
Band2	15MHz	16QAM	26915	75RB#0	VN	NT	-2.56	-0.003060	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

6										
Band2 6	15MHz	16QAM	26915	75RB#0	VH	NT	-2.55	-0.003048	±2.5	PASS
Band2 6	15MHz	16QAM	26965	75RB#0	VL	NT	-4.31	-0.005122	±2.5	PASS
Band2 6	15MHz	16QAM	26965	75RB#0	VN	NT	-2.63	-0.003125	±2.5	PASS
Band2 6	15MHz	16QAM	26965	75RB#0	VH	NT	-4.49	-0.005336	±2.5	PASS

Appendix G: Frequency stability VS Temperature measurement

Test Result

Band	Bandwidth	Modulation	Channel	Temperature						
				RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-30	-3.42	-0.001848	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-20	-4.85	-0.002621	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	0	-5.38	-0.002907	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	10	-5.19	-0.002804	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	20	-6.01	-0.003247	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	-5.84	-0.003106	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	-5.31	-0.002824	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	-8.37	-0.004452	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	-7.65	-0.004069	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	-4.53	-0.002410	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-30	-5.46	-0.002860	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-20	2.89	0.001514	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	0	-4.36	-0.002284	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	10	-4.22	-0.002210	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	20	-3.79	-0.001985	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-30	-6.68	-0.003609	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-20	-5.28	-0.002853	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	0	-3.79	-0.002048	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	10	-4.25	-0.002296	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	20	-8.31	-0.004490	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-30	-7.41	-0.003941	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-20	-7.41	-0.003941	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	0	-6.24	-0.003319	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	10	-5.92	-0.003149	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	20	-7.45	-0.003963	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-30	-2.22	-0.001163	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-20	3.99	0.002090	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	0	2.42	0.001267	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	10	3.59	0.001880	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	20	5.24	0.002744	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-30	-4.02	-0.002171	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-20	-5.62	-0.003035	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	0	-4.33	-0.002339	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	10	-6.01	-0.003246	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band2	3MHz	QPSK	18615	15RB#0	NV	20	-4.21	-0.002274	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-30	-7.67	-0.004080	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-20	-4.99	-0.002654	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	-6.90	-0.003670	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	10	-9.14	-0.004862	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	-8.55	-0.004548	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-30	-4.02	-0.002106	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-20	2.42	0.001268	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	0	-4.72	-0.002473	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	10	2.32	0.001216	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	20	2.40	0.001258	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-30	-5.16	-0.002787	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-20	-5.82	-0.003143	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	0	-8.27	-0.004467	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	10	-7.58	-0.004094	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	20	-3.16	-0.001707	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-30	-6.94	-0.003691	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-20	-7.85	-0.004176	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	0	-5.98	-0.003181	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	10	-4.75	-0.002527	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	20	-6.08	-0.003234	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-30	-4.31	-0.002258	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-20	-2.76	-0.001446	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	0	4.08	0.002138	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	10	3.18	0.001666	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	20	3.15	0.001651	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-30	-3.36	-0.001814	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-20	-2.72	-0.001468	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	0	-5.64	-0.003045	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	10	-6.57	-0.003547	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	20	-4.58	-0.002472	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	-6.51	-0.003463	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	-7.47	-0.003973	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	0	-5.28	-0.002809	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	-6.25	-0.003324	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	-6.94	-0.003691	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-30	-5.04	-0.002642	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-20	3.30	0.001730	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	0	-3.42	-0.001793	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	10	2.68	0.001405	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	20	3.52	0.001845	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band2	5MHz	16QAM	18625	25RB#0	NV	-30	-6.77	-0.003655	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-20	-3.33	-0.001798	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	0	-3.32	-0.001792	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	10	-6.54	-0.003530	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	20	-2.88	-0.001555	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-30	-7.37	-0.003920	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-20	-5.12	-0.002723	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	0	-7.51	-0.003995	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	10	-5.56	-0.002957	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	20	-4.01	-0.002133	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-30	-4.88	-0.002558	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-20	2.95	0.001547	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	0	-3.33	-0.001746	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	10	3.12	0.001636	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	20	3.28	0.001720	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-30	-5.61	-0.003024	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-20	-6.55	-0.003531	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	0	-5.98	-0.003224	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	10	-3.78	-0.002038	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	20	-3.19	-0.001720	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	-7.08	-0.003766	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-20	-6.87	-0.003654	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	-10.00	-0.005319	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	-5.14	-0.002734	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	-7.71	-0.004101	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-30	3.16	0.001659	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-20	3.49	0.001832	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	0	2.86	0.001501	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	10	-4.88	-0.002562	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	20	4.46	0.002341	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-30	-6.97	-0.003757	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-20	-5.91	-0.003186	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	0	-9.96	-0.005369	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	10	-6.61	-0.003563	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	20	-7.22	-0.003892	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-30	-7.95	-0.004229	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-20	-7.21	-0.003835	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	0	-6.24	-0.003319	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	10	-4.65	-0.002473	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	20	-5.74	-0.003053	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-30	-5.19	-0.002724	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band2	10MHz	16QAM	19150	50RB#0	NV	-20	4.36	0.002289	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	0	3.42	0.001795	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	10	-4.68	-0.002457	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	20	6.31	0.003312	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-30	-8.97	-0.004829	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-20	-8.70	-0.004684	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	0	-7.18	-0.003865	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	10	-4.89	-0.002633	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	20	-5.97	-0.003214	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-30	-9.03	-0.004803	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-20	-7.01	-0.003729	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	0	-6.92	-0.003681	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	10	-5.09	-0.002707	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	20	-8.01	-0.004261	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-30	-9.31	-0.004894	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-20	-6.18	-0.003248	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	0	-7.04	-0.003700	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	10	-7.15	-0.003758	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	20	-7.22	-0.003795	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-30	-4.89	-0.002633	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-20	-6.48	-0.003489	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	0	-4.53	-0.002439	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	10	-5.88	-0.003166	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	20	-7.12	-0.003833	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-30	-9.10	-0.004840	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-20	-7.74	-0.004117	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	0	-7.80	-0.004149	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	10	-6.98	-0.003713	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	20	-7.32	-0.003894	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-30	-8.13	-0.004273	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-20	-8.51	-0.004473	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	0	-6.81	-0.003580	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	10	-6.72	-0.003532	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	20	-6.05	-0.003180	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-30	-3.73	-0.002005	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-20	-2.53	-0.001360	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	0	5.68	0.003054	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	10	3.33	0.001790	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	20	3.69	0.001984	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-30	-6.49	-0.003452	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-20	-6.52	-0.003468	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band2	20MHz	QPSK	18900	100RB#0	NV	0	-6.25	-0.003324	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	10	-6.18	-0.003287	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	20	-9.73	-0.005176	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-30	-4.84	-0.002547	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-20	-4.52	-0.002379	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	0	-5.26	-0.002768	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	10	-5.52	-0.002905	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	20	-5.32	-0.002800	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-30	-3.83	-0.002059	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-20	5.89	0.003167	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	0	-2.92	-0.001570	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	10	2.46	0.001323	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	20	3.89	0.002091	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-30	-7.25	-0.003856	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-20	-6.24	-0.003319	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	0	-5.82	-0.003096	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	10	-6.38	-0.003394	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	20	-6.90	-0.003670	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-30	-5.01	-0.002637	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-20	-5.31	-0.002795	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	0	-6.25	-0.003289	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	10	-6.29	-0.003311	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	20	-3.72	-0.001958	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	-30	4.56	0.002666	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	-20	5.06	0.002958	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	0	5.71	0.003338	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	10	2.37	0.001385	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	20	2.92	0.001707	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-30	-4.39	-0.002534	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-20	-4.23	-0.002442	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	0	3.06	0.001766	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	10	-2.86	-0.001651	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	20	-4.18	-0.002413	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	-30	-5.05	-0.002879	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	-20	-6.41	-0.003654	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	0	-7.11	-0.004053	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	10	-4.58	-0.002611	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	20	-5.69	-0.003243	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	-30	-3.78	-0.002210	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	-20	2.92	0.001707	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	0	5.19	0.003034	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band4	1.4MHz	16QAM	19957	6RB#0	NV	10	3.32	0.001941	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	20	4.82	0.002818	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	-30	2.12	0.001224	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	-20	2.50	0.001443	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	0	5.05	0.002915	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	10	-4.91	-0.002834	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	20	4.09	0.002361	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	-30	-5.24	-0.002987	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	-20	-6.74	-0.003842	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	0	-6.42	-0.003660	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	10	-8.27	-0.004714	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	20	-3.33	-0.001898	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	-30	4.09	0.002390	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	-20	3.98	0.002325	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	0	3.06	0.001788	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	10	3.09	0.001805	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	20	3.99	0.002331	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	-30	-3.58	-0.002066	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	-20	-1.63	-0.000941	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	0	-1.82	-0.001051	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	10	5.35	0.003088	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	20	3.55	0.002049	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	-30	-2.85	-0.001625	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	-20	-4.05	-0.002310	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	0	3.81	0.002173	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	10	6.38	0.003638	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	20	-5.55	-0.003165	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	-30	3.93	0.002296	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	-20	5.14	0.003003	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	0	2.52	0.001472	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	10	5.15	0.003009	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	20	-2.82	-0.001648	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	-30	-2.95	-0.001703	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	-20	4.59	0.002649	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	0	-3.66	-0.002113	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	10	3.28	0.001893	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	20	-3.36	-0.001939	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	-30	4.13	0.002355	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	-20	4.75	0.002709	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	0	4.45	0.002538	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	10	-2.57	-0.001466	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band4	3MHz	16QAM	20385	15RB#0	NV	20	4.91	0.002800	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	-30	6.62	0.003866	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	-20	4.76	0.002780	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	0	5.54	0.003235	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	10	-3.26	-0.001904	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	20	3.42	0.001997	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-30	3.40	0.001962	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-20	3.23	0.001864	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	0	-1.36	-0.000785	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	10	-3.36	-0.001939	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	20	2.98	0.001720	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	-30	-4.23	-0.002414	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	-20	-6.82	-0.003892	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	0	-5.61	-0.003201	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	10	-5.94	-0.003389	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	20	-6.85	-0.003909	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	-30	2.98	0.001740	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	-20	2.73	0.001594	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	0	6.77	0.003953	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	10	-4.71	-0.002750	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	20	-3.28	-0.001915	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	-30	2.85	0.001645	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	-20	3.55	0.002049	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	0	4.16	0.002401	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	10	-5.74	-0.003313	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	20	-2.55	-0.001472	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	-30	-7.01	-0.004000	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	-20	-5.25	-0.002996	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	0	-4.61	-0.002631	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	10	-5.41	-0.003087	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	20	-6.49	-0.003703	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	-30	-7.24	-0.004222	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	-20	-5.99	-0.003493	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	0	-7.42	-0.004327	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	10	-5.21	-0.003038	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	20	-4.59	-0.002676	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-30	5.02	0.002898	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-20	-3.58	-0.002066	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	0	-4.15	-0.002395	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	10	5.08	0.002932	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	20	-4.55	-0.002626	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band4	10MHz	QPSK	20350	50RB#0	NV	-30	4.55	0.002600	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	-20	4.68	0.002674	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	0	2.45	0.001400	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	10	3.59	0.002051	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	20	6.95	0.003971	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	-30	-6.44	-0.003755	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	-20	-6.47	-0.003773	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	0	-5.64	-0.003289	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	10	-6.17	-0.003598	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	20	-6.08	-0.003545	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	-30	-2.60	-0.001501	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	-20	-4.22	-0.002436	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	0	2.88	0.001662	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	10	3.35	0.001934	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	20	4.79	0.002765	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	-30	5.18	0.002960	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	-20	5.35	0.003057	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	0	4.26	0.002434	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	10	3.89	0.002223	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	20	4.28	0.002446	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	-30	-3.45	-0.002009	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	-20	-6.71	-0.003907	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	0	3.42	0.001991	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	10	5.89	0.003429	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	20	3.72	0.002166	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-30	3.33	0.001922	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-20	-3.81	-0.002199	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	0	-4.15	-0.002395	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	10	3.79	0.002188	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	20	2.30	0.001328	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	-30	-4.13	-0.002363	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	-20	-3.76	-0.002152	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	0	2.72	0.001557	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	10	3.89	0.002226	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	20	-2.29	-0.001310	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	-30	-2.85	-0.001659	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	-20	3.79	0.002207	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	0	-6.37	-0.003709	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	10	6.08	0.003540	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	20	3.35	0.001951	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	-30	4.68	0.002701	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band4	15MHz	16QAM	20175	75RB#0	NV	-20	3.36	0.001939	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	0	4.84	0.002794	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	10	-2.92	-0.001685	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	20	-2.59	-0.001495	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	-30	4.22	0.002415	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	-20	-3.89	-0.002226	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	0	3.23	0.001848	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	10	-3.06	-0.001751	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	20	-3.83	-0.002192	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	-30	4.28	0.002488	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	-20	5.02	0.002919	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	0	-3.60	-0.002093	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	10	4.43	0.002576	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	20	7.84	0.004558	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	-30	3.25	0.001876	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	-20	5.55	0.003203	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	0	-2.00	-0.001154	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	10	-3.93	-0.002268	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	20	3.62	0.002089	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	-30	-4.36	-0.002499	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	-20	-5.69	-0.003261	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	0	-7.47	-0.004281	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	10	-4.98	-0.002854	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	20	-4.63	-0.002653	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	-30	3.62	0.002105	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	-20	3.59	0.002087	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	0	4.52	0.002628	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	10	4.32	0.002512	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	20	4.01	0.002331	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	-30	3.05	0.001760	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	-20	-5.36	-0.003094	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	0	3.35	0.001934	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	10	3.76	0.002170	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	20	-3.59	-0.002072	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	-30	-5.18	-0.002968	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	-20	-4.85	-0.002779	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	0	-6.49	-0.003719	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	10	-4.92	-0.002819	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	20	-6.08	-0.003484	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	NV	-30	-2.26	-0.002740	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	NV	-20	-3.22	-0.003904	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com

Band5	1.4MHz	QPSK	20407	6RB#0	NV	0	-2.69	-0.003262	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	NV	10	-3.81	-0.004620	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	NV	20	-4.09	-0.004959	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	-30	-2.50	-0.002989	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	-20	-2.56	-0.003060	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	0	-3.46	-0.004136	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	10	-3.18	-0.003802	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	20	-1.70	-0.002032	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	NV	-30	-3.18	-0.003749	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	NV	-20	-1.57	-0.001851	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	NV	0	2.45	0.002888	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	NV	10	3.16	0.003725	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	NV	20	-3.66	-0.004315	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	NV	-30	-2.39	-0.002898	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	NV	-20	-3.66	-0.004438	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	NV	0	-3.91	-0.004741	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	NV	10	-3.50	-0.004244	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	NV	20	-3.76	-0.004559	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	NV	-30	-2.46	-0.002941	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	NV	-20	-2.00	-0.002391	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	NV	0	-2.62	-0.003132	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	NV	10	-2.46	-0.002941	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	NV	20	-2.25	-0.002690	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	NV	-30	-2.53	-0.002982	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	NV	-20	1.53	0.001804	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	NV	0	1.83	0.002157	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	NV	10	-1.44	-0.001698	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	NV	20	1.40	0.001650	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	NV	-30	-2.88	-0.003489	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	NV	-20	-3.65	-0.004422	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	NV	0	-2.57	-0.003113	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	NV	10	2.29	0.002774	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	NV	20	-3.25	-0.003937	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	-30	-4.48	-0.005356	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	-20	-5.08	-0.006073	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	0	-5.08	-0.006073	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	10	2.82	0.003371	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	20	-3.73	-0.004459	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	NV	-30	-2.73	-0.003221	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	NV	-20	-4.61	-0.005440	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	NV	0	-3.03	-0.003575	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band5	3MHz	QPSK	20635	15RB#0	NV	10	-6.11	-0.007209	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	NV	20	-4.45	-0.005251	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	NV	-30	3.39	0.004107	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	NV	-20	1.69	0.002047	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	NV	0	2.05	0.002483	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	NV	10	2.72	0.003295	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	NV	20	-2.12	-0.002568	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	NV	-30	-3.06	-0.003658	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	NV	-20	-1.76	-0.002104	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	NV	0	2.45	0.002929	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	NV	10	-3.93	-0.004698	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	NV	20	-2.70	-0.003228	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	NV	-30	-3.92	-0.004625	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	NV	-20	-4.12	-0.004861	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	NV	0	-3.08	-0.003634	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	NV	10	-2.33	-0.002749	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	NV	20	-4.06	-0.004791	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	NV	-30	-4.88	-0.005904	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	NV	-20	-2.63	-0.003182	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	NV	0	-2.80	-0.003388	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	NV	10	-4.46	-0.005396	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	NV	20	-5.54	-0.006703	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	-30	-3.58	-0.004280	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	-20	-2.55	-0.003048	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	0	-2.30	-0.002750	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	10	-1.99	-0.002379	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	20	-4.25	-0.005081	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	NV	-30	2.06	0.002434	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	NV	-20	1.56	0.001843	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	NV	0	-2.63	-0.003107	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	NV	10	-2.43	-0.002871	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	NV	20	-2.35	-0.002776	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	NV	-30	-3.82	-0.004622	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	NV	-20	-3.48	-0.004211	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	NV	0	-3.71	-0.004489	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	NV	10	-3.83	-0.004634	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	NV	20	-4.05	-0.004900	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	NV	-30	-2.47	-0.002953	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	NV	-20	-3.38	-0.004041	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	NV	0	-3.45	-0.004124	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	NV	10	-2.95	-0.003527	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band5	5MHz	16QAM	20525	25RB#0	NV	20	-1.36	-0.001626	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	NV	-30	-1.99	-0.002351	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	NV	-20	2.17	0.002563	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	NV	0	-2.07	-0.002445	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	NV	10	2.70	0.003190	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	NV	20	2.29	0.002705	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	NV	-30	-3.63	-0.004379	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	NV	-20	-2.56	-0.003088	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	NV	0	-2.56	-0.003088	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	NV	10	-2.53	-0.003052	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	NV	20	-2.56	-0.003088	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	-30	2.50	0.002989	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	-20	-2.06	-0.002463	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	0	-2.57	-0.003072	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	10	2.59	0.003096	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	20	-1.66	-0.001984	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	NV	-30	-2.57	-0.003045	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	NV	-20	-2.57	-0.003045	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	NV	0	-2.35	-0.002784	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	NV	10	-1.22	-0.001445	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	NV	20	-4.22	-0.005000	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	NV	-30	-2.96	-0.003571	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	NV	-20	-4.12	-0.004970	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	NV	0	-2.78	-0.003353	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	NV	10	-3.63	-0.004379	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	NV	20	-2.26	-0.002726	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	NV	-30	-2.12	-0.002534	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	NV	-20	-2.25	-0.002690	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	NV	0	2.19	0.002618	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	NV	10	-3.06	-0.003658	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	NV	20	-4.13	-0.004937	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	NV	-30	-1.83	-0.002168	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	NV	-20	-2.12	-0.002512	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	NV	0	-3.59	-0.004254	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	NV	10	-3.22	-0.003815	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	NV	20	-2.76	-0.003270	±2.5	PASS
Band1 2	1.4MHz	QPSK	23017	6RB#0	NV	-30	-3.16	-0.004516	±2.5	PASS
Band1 2	1.4MHz	QPSK	23017	6RB#0	NV	-20	-1.82	-0.002601	±2.5	PASS
Band1	1.4MHz	QPSK	23017	6RB#0	NV	0	-2.78	-0.003973	±2.5	PASS

2										
Band1 2	1.4MHz	QPSK	23017	6RB#0	NV	10	-1.43	-0.002044	±2.5	PASS
Band1 2	1.4MHz	QPSK	23017	6RB#0	NV	20	-1.95	-0.002787	±2.5	PASS
Band1 2	1.4MHz	QPSK	23095	6RB#0	NV	-30	-2.98	-0.004212	±2.5	PASS
Band1 2	1.4MHz	QPSK	23095	6RB#0	NV	-20	-1.53	-0.002163	±2.5	PASS
Band1 2	1.4MHz	QPSK	23095	6RB#0	NV	0	-2.73	-0.003859	±2.5	PASS
Band1 2	1.4MHz	QPSK	23095	6RB#0	NV	10	1.99	0.002813	±2.5	PASS
Band1 2	1.4MHz	QPSK	23095	6RB#0	NV	20	-2.10	-0.002968	±2.5	PASS
Band1 2	1.4MHz	QPSK	23173	6RB#0	NV	-30	-3.00	-0.004194	±2.5	PASS
Band1 2	1.4MHz	QPSK	23173	6RB#0	NV	-20	-2.16	-0.003020	±2.5	PASS
Band1 2	1.4MHz	QPSK	23173	6RB#0	NV	0	-1.89	-0.002642	±2.5	PASS
Band1 2	1.4MHz	QPSK	23173	6RB#0	NV	10	1.22	0.001706	±2.5	PASS
Band1 2	1.4MHz	QPSK	23173	6RB#0	NV	20	2.37	0.003313	±2.5	PASS
Band1 2	1.4MHz	16QAM	23017	6RB#0	NV	-30	-1.77	-0.002530	±2.5	PASS
Band1 2	1.4MHz	16QAM	23017	6RB#0	NV	-20	-2.37	-0.003387	±2.5	PASS
Band1 2	1.4MHz	16QAM	23017	6RB#0	NV	0	-4.23	-0.006045	±2.5	PASS
Band1 2	1.4MHz	16QAM	23017	6RB#0	NV	10	1.40	0.002001	±2.5	PASS
Band1 2	1.4MHz	16QAM	23017	6RB#0	NV	20	-3.19	-0.004559	±2.5	PASS
Band1 2	1.4MHz	16QAM	23095	6RB#0	NV	-30	-2.95	-0.004170	±2.5	PASS
Band1 2	1.4MHz	16QAM	23095	6RB#0	NV	-20	-2.39	-0.003378	±2.5	PASS
Band1 2	1.4MHz	16QAM	23095	6RB#0	NV	0	-2.02	-0.002855	±2.5	PASS
Band1	1.4MHz	16QAM	23095	6RB#0	NV	10	-1.63	-0.002304	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

2										
Band1 2	1.4MHz	16QAM	23095	6RB#0	NV	20	-2.37	-0.003350	±2.5	PASS
Band1 2	1.4MHz	16QAM	23173	6RB#0	NV	-30	2.30	0.003215	±2.5	PASS
Band1 2	1.4MHz	16QAM	23173	6RB#0	NV	-20	-4.71	-0.006585	±2.5	PASS
Band1 2	1.4MHz	16QAM	23173	6RB#0	NV	0	-2.82	-0.003942	±2.5	PASS
Band1 2	1.4MHz	16QAM	23173	6RB#0	NV	10	-2.57	-0.003593	±2.5	PASS
Band1 2	1.4MHz	16QAM	23173	6RB#0	NV	20	-2.05	-0.002866	±2.5	PASS
Band1 2	3MHz	QPSK	23025	15RB#0	NV	-30	3.22	0.004597	±2.5	PASS
Band1 2	3MHz	QPSK	23025	15RB#0	NV	-20	2.00	0.002855	±2.5	PASS
Band1 2	3MHz	QPSK	23025	15RB#0	NV	0	-1.76	-0.002512	±2.5	PASS
Band1 2	3MHz	QPSK	23025	15RB#0	NV	10	-2.16	-0.003084	±2.5	PASS
Band1 2	3MHz	QPSK	23025	15RB#0	NV	20	-2.66	-0.003797	±2.5	PASS
Band1 2	3MHz	QPSK	23095	15RB#0	NV	-30	-3.06	-0.004325	±2.5	PASS
Band1 2	3MHz	QPSK	23095	15RB#0	NV	-20	-3.40	-0.004806	±2.5	PASS
Band1 2	3MHz	QPSK	23095	15RB#0	NV	0	-2.10	-0.002968	±2.5	PASS
Band1 2	3MHz	QPSK	23095	15RB#0	NV	10	2.16	0.003053	±2.5	PASS
Band1 2	3MHz	QPSK	23095	15RB#0	NV	20	-3.58	-0.005060	±2.5	PASS
Band1 2	3MHz	QPSK	23165	15RB#0	NV	-30	-2.82	-0.003947	±2.5	PASS
Band1 2	3MHz	QPSK	23165	15RB#0	NV	-20	-2.80	-0.003919	±2.5	PASS
Band1 2	3MHz	QPSK	23165	15RB#0	NV	0	-3.79	-0.005304	±2.5	PASS
Band1 2	3MHz	QPSK	23165	15RB#0	NV	10	-2.90	-0.004059	±2.5	PASS
Band1	3MHz	QPSK	23165	15RB#0	NV	20	-2.50	-0.003499	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

2										
Band1 2	3MHz	16QAM	23025	15RB#0	NV	-30	-2.50	-0.003569	±2.5	PASS
Band1 2	3MHz	16QAM	23025	15RB#0	NV	-20	-2.50	-0.003569	±2.5	PASS
Band1 2	3MHz	16QAM	23025	15RB#0	NV	0	-2.06	-0.002941	±2.5	PASS
Band1 2	3MHz	16QAM	23025	15RB#0	NV	10	-1.70	-0.002427	±2.5	PASS
Band1 2	3MHz	16QAM	23025	15RB#0	NV	20	1.93	0.002755	±2.5	PASS
Band1 2	3MHz	16QAM	23095	15RB#0	NV	-30	-2.29	-0.003237	±2.5	PASS
Band1 2	3MHz	16QAM	23095	15RB#0	NV	-20	-2.40	-0.003392	±2.5	PASS
Band1 2	3MHz	16QAM	23095	15RB#0	NV	0	2.26	0.003194	±2.5	PASS
Band1 2	3MHz	16QAM	23095	15RB#0	NV	10	-2.66	-0.003760	±2.5	PASS
Band1 2	3MHz	16QAM	23095	15RB#0	NV	20	2.52	0.003562	±2.5	PASS
Band1 2	3MHz	16QAM	23165	15RB#0	NV	-30	1.59	0.002225	±2.5	PASS
Band1 2	3MHz	16QAM	23165	15RB#0	NV	-20	2.46	0.003443	±2.5	PASS
Band1 2	3MHz	16QAM	23165	15RB#0	NV	0	-2.27	-0.003177	±2.5	PASS
Band1 2	3MHz	16QAM	23165	15RB#0	NV	10	-2.23	-0.003121	±2.5	PASS
Band1 2	3MHz	16QAM	23165	15RB#0	NV	20	3.05	0.004269	±2.5	PASS
Band1 2	5MHz	QPSK	23035	25RB#0	NV	-30	-3.55	-0.005061	±2.5	PASS
Band1 2	5MHz	QPSK	23035	25RB#0	NV	-20	-3.69	-0.005260	±2.5	PASS
Band1 2	5MHz	QPSK	23035	25RB#0	NV	0	-2.43	-0.003464	±2.5	PASS
Band1 2	5MHz	QPSK	23035	25RB#0	NV	10	-2.07	-0.002951	±2.5	PASS
Band1 2	5MHz	QPSK	23035	25RB#0	NV	20	-3.12	-0.004448	±2.5	PASS
Band1	5MHz	QPSK	23095	25RB#0	NV	-30	-2.49	-0.003519	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

2										
Band1 2	5MHz	QPSK	23095	25RB#0	NV	-20	-3.02	-0.004269	±2.5	PASS
Band1 2	5MHz	QPSK	23095	25RB#0	NV	0	-1.82	-0.002572	±2.5	PASS
Band1 2	5MHz	QPSK	23095	25RB#0	NV	10	-2.23	-0.003152	±2.5	PASS
Band1 2	5MHz	QPSK	23095	25RB#0	NV	20	-1.80	-0.002544	±2.5	PASS
Band1 2	5MHz	QPSK	23155	25RB#0	NV	-30	-2.03	-0.002845	±2.5	PASS
Band1 2	5MHz	QPSK	23155	25RB#0	NV	-20	-2.29	-0.003210	±2.5	PASS
Band1 2	5MHz	QPSK	23155	25RB#0	NV	0	2.65	0.003714	±2.5	PASS
Band1 2	5MHz	QPSK	23155	25RB#0	NV	10	-3.66	-0.005130	±2.5	PASS
Band1 2	5MHz	QPSK	23155	25RB#0	NV	20	-3.89	-0.005452	±2.5	PASS
Band1 2	5MHz	16QAM	23035	25RB#0	NV	-30	-2.93	-0.004177	±2.5	PASS
Band1 2	5MHz	16QAM	23035	25RB#0	NV	-20	-3.23	-0.004604	±2.5	PASS
Band1 2	5MHz	16QAM	23035	25RB#0	NV	0	-1.56	-0.002224	±2.5	PASS
Band1 2	5MHz	16QAM	23035	25RB#0	NV	10	-1.77	-0.002523	±2.5	PASS
Band1 2	5MHz	16QAM	23035	25RB#0	NV	20	-1.83	-0.002609	±2.5	PASS
Band1 2	5MHz	16QAM	23095	25RB#0	NV	-30	-3.75	-0.005300	±2.5	PASS
Band1 2	5MHz	16QAM	23095	25RB#0	NV	-20	-3.65	-0.005159	±2.5	PASS
Band1 2	5MHz	16QAM	23095	25RB#0	NV	0	-2.79	-0.003943	±2.5	PASS
Band1 2	5MHz	16QAM	23095	25RB#0	NV	10	-2.72	-0.003845	±2.5	PASS
Band1 2	5MHz	16QAM	23095	25RB#0	NV	20	-1.52	-0.002148	±2.5	PASS
Band1 2	5MHz	16QAM	23155	25RB#0	NV	-30	-2.63	-0.003686	±2.5	PASS
Band1	5MHz	16QAM	23155	25RB#0	NV	-20	-2.42	-0.003392	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

2										
Band1 2	5MHz	16QAM	23155	25RB#0	NV	0	-2.60	-0.003644	±2.5	PASS
Band1 2	5MHz	16QAM	23155	25RB#0	NV	10	-4.01	-0.005620	±2.5	PASS
Band1 2	5MHz	16QAM	23155	25RB#0	NV	20	-2.63	-0.003686	±2.5	PASS
Band1 2	10MHz	QPSK	23060	50RB#0	NV	-30	-3.09	-0.004389	±2.5	PASS
Band1 2	10MHz	QPSK	23060	50RB#0	NV	-20	-2.82	-0.004006	±2.5	PASS
Band1 2	10MHz	QPSK	23060	50RB#0	NV	0	-3.71	-0.005270	±2.5	PASS
Band1 2	10MHz	QPSK	23060	50RB#0	NV	10	-2.73	-0.003878	±2.5	PASS
Band1 2	10MHz	QPSK	23060	50RB#0	NV	20	-3.93	-0.005582	±2.5	PASS
Band1 2	10MHz	QPSK	23095	50RB#0	NV	-30	-3.20	-0.004523	±2.5	PASS
Band1 2	10MHz	QPSK	23095	50RB#0	NV	-20	-4.25	-0.006007	±2.5	PASS
Band1 2	10MHz	QPSK	23095	50RB#0	NV	0	-2.60	-0.003675	±2.5	PASS
Band1 2	10MHz	QPSK	23095	50RB#0	NV	10	-3.65	-0.005159	±2.5	PASS
Band1 2	10MHz	QPSK	23095	50RB#0	NV	20	-2.98	-0.004212	±2.5	PASS
Band1 2	10MHz	QPSK	23130	50RB#0	NV	-30	-5.38	-0.007567	±2.5	PASS
Band1 2	10MHz	QPSK	23130	50RB#0	NV	-20	-2.47	-0.003474	±2.5	PASS
Band1 2	10MHz	QPSK	23130	50RB#0	NV	0	-4.45	-0.006259	±2.5	PASS
Band1 2	10MHz	QPSK	23130	50RB#0	NV	10	-4.45	-0.006259	±2.5	PASS
Band1 2	10MHz	QPSK	23130	50RB#0	NV	20	-2.72	-0.003826	±2.5	PASS
Band1 2	10MHz	16QAM	23060	50RB#0	NV	-30	2.62	0.003722	±2.5	PASS
Band1 2	10MHz	16QAM	23060	50RB#0	NV	-20	-3.02	-0.004290	±2.5	PASS
Band1	10MHz	16QAM	23060	50RB#0	NV	0	-1.87	-0.002656	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

2										
Band1 2	10MHz	16QAM	23060	50RB#0	NV	10	2.03	0.002884	±2.5	PASS
Band1 2	10MHz	16QAM	23060	50RB#0	NV	20	1.12	0.001591	±2.5	PASS
Band1 2	10MHz	16QAM	23095	50RB#0	NV	-30	-2.78	-0.003929	±2.5	PASS
Band1 2	10MHz	16QAM	23095	50RB#0	NV	-20	1.40	0.001979	±2.5	PASS
Band1 2	10MHz	16QAM	23095	50RB#0	NV	0	-1.87	-0.002643	±2.5	PASS
Band1 2	10MHz	16QAM	23095	50RB#0	NV	10	2.36	0.003336	±2.5	PASS
Band1 2	10MHz	16QAM	23095	50RB#0	NV	20	3.03	0.004283	±2.5	PASS
Band1 2	10MHz	16QAM	23130	50RB#0	NV	-30	-2.79	-0.003924	±2.5	PASS
Band1 2	10MHz	16QAM	23130	50RB#0	NV	-20	-2.82	-0.003966	±2.5	PASS
Band1 2	10MHz	16QAM	23130	50RB#0	NV	0	-2.43	-0.003418	±2.5	PASS
Band1 2	10MHz	16QAM	23130	50RB#0	NV	10	-4.06	-0.005710	±2.5	PASS
Band1 2	10MHz	16QAM	23130	50RB#0	NV	20	-2.59	-0.003643	±2.5	PASS
Band1 3	5MHz	QPSK	23205	25RB#0	NV	-30	-2.80	-0.003592	±2.5	PASS
Band1 3	5MHz	QPSK	23205	25RB#0	NV	-20	-3.12	-0.004003	±2.5	PASS
Band1 3	5MHz	QPSK	23205	25RB#0	NV	0	-3.38	-0.004336	±2.5	PASS
Band1 3	5MHz	QPSK	23205	25RB#0	NV	10	-4.76	-0.006106	±2.5	PASS
Band1 3	5MHz	QPSK	23205	25RB#0	NV	20	-5.08	-0.006517	±2.5	PASS
Band1 3	5MHz	QPSK	23230	25RB#0	NV	-30	1.30	0.001662	±2.5	PASS
Band1 3	5MHz	QPSK	23230	25RB#0	NV	-20	-1.79	-0.002289	±2.5	PASS
Band1 3	5MHz	QPSK	23230	25RB#0	NV	0	-2.90	-0.003708	±2.5	PASS
Band1	5MHz	QPSK	23230	25RB#0	NV	10	2.76	0.003529	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

3										
Band1 3	5MHz	QPSK	23230	25RB#0	NV	20	1.83	0.002340	±2.5	PASS
Band1 3	5MHz	QPSK	23255	25RB#0	NV	-30	3.15	0.004015	±2.5	PASS
Band1 3	5MHz	QPSK	23255	25RB#0	NV	-20	-2.32	-0.002957	±2.5	PASS
Band1 3	5MHz	QPSK	23255	25RB#0	NV	0	1.82	0.002320	±2.5	PASS
Band1 3	5MHz	QPSK	23255	25RB#0	NV	10	-2.40	-0.003059	±2.5	PASS
Band1 3	5MHz	QPSK	23255	25RB#0	NV	20	-3.26	-0.004156	±2.5	PASS
Band1 3	5MHz	16QAM	23205	25RB#0	NV	-30	-6.12	-0.007851	±2.5	PASS
Band1 3	5MHz	16QAM	23205	25RB#0	NV	-20	-1.97	-0.002527	±2.5	PASS
Band1 3	5MHz	16QAM	23205	25RB#0	NV	0	-2.46	-0.003156	±2.5	PASS
Band1 3	5MHz	16QAM	23205	25RB#0	NV	10	-3.55	-0.004554	±2.5	PASS
Band1 3	5MHz	16QAM	23205	25RB#0	NV	20	-4.03	-0.005170	±2.5	PASS
Band1 3	5MHz	16QAM	23230	25RB#0	NV	-30	-3.58	-0.004578	±2.5	PASS
Band1 3	5MHz	16QAM	23230	25RB#0	NV	-20	-7.68	-0.009821	±2.5	PASS
Band1 3	5MHz	16QAM	23230	25RB#0	NV	0	-3.59	-0.004591	±2.5	PASS
Band1 3	5MHz	16QAM	23230	25RB#0	NV	10	-3.69	-0.004719	±2.5	PASS
Band1 3	5MHz	16QAM	23230	25RB#0	NV	20	-2.78	-0.003555	±2.5	PASS
Band1 3	5MHz	16QAM	23255	25RB#0	NV	-30	-3.56	-0.004538	±2.5	PASS
Band1 3	5MHz	16QAM	23255	25RB#0	NV	-20	-2.33	-0.002970	±2.5	PASS
Band1 3	5MHz	16QAM	23255	25RB#0	NV	0	2.29	0.002919	±2.5	PASS
Band1 3	5MHz	16QAM	23255	25RB#0	NV	10	-3.32	-0.004232	±2.5	PASS
Band1	5MHz	16QAM	23255	25RB#0	NV	20	-2.93	-0.003735	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

3										
Band1 3	10MHz	QPSK	23230	50RB#0	NV	-30	-3.22	-0.004118	±2.5	PASS
Band1 3	10MHz	QPSK	23230	50RB#0	NV	-20	-3.78	-0.004834	±2.5	PASS
Band1 3	10MHz	QPSK	23230	50RB#0	NV	0	-3.18	-0.004066	±2.5	PASS
Band1 3	10MHz	QPSK	23230	50RB#0	NV	10	-1.82	-0.002327	±2.5	PASS
Band1 3	10MHz	QPSK	23230	50RB#0	NV	20	-2.55	-0.003261	±2.5	PASS
Band1 3	10MHz	16QAM	23230	50RB#0	NV	-30	-2.47	-0.003159	±2.5	PASS
Band1 3	10MHz	16QAM	23230	50RB#0	NV	-20	1.30	0.001662	±2.5	PASS
Band1 3	10MHz	16QAM	23230	50RB#0	NV	0	2.90	0.003708	±2.5	PASS
Band1 3	10MHz	16QAM	23230	50RB#0	NV	10	1.30	0.001662	±2.5	PASS
Band1 3	10MHz	16QAM	23230	50RB#0	NV	20	3.18	0.004066	±2.5	PASS
Band2 5	1.4MHz	QPSK	26047	6RB#0	NV	-30	-5.24	-0.002831	±2.5	PASS
Band2 5	1.4MHz	QPSK	26047	6RB#0	NV	-20	-7.88	-0.004258	±2.5	PASS
Band2 5	1.4MHz	QPSK	26047	6RB#0	NV	0	-2.43	-0.001313	±2.5	PASS
Band2 5	1.4MHz	QPSK	26047	6RB#0	NV	10	-6.09	-0.003291	±2.5	PASS
Band2 5	1.4MHz	QPSK	26047	6RB#0	NV	20	-3.58	-0.001934	±2.5	PASS
Band2 5	1.4MHz	QPSK	26365	6RB#0	NV	-30	3.19	0.001695	±2.5	PASS
Band2 5	1.4MHz	QPSK	26365	6RB#0	NV	-20	-5.44	-0.002890	±2.5	PASS
Band2 5	1.4MHz	QPSK	26365	6RB#0	NV	0	4.68	0.002486	±2.5	PASS
Band2 5	1.4MHz	QPSK	26365	6RB#0	NV	10	3.83	0.002035	±2.5	PASS
Band2 5	1.4MHz	QPSK	26365	6RB#0	NV	20	-3.78	-0.002008	±2.5	PASS
Band2	1.4MHz	QPSK	26683	6RB#0	NV	-30	-8.05	-0.004205	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

5										
Band2 5	1.4MHz	QPSK	26683	6RB#0	NV	-20	-6.18	-0.003228	±2.5	PASS
Band2 5	1.4MHz	QPSK	26683	6RB#0	NV	0	-4.79	-0.002502	±2.5	PASS
Band2 5	1.4MHz	QPSK	26683	6RB#0	NV	10	-8.85	-0.004623	±2.5	PASS
Band2 5	1.4MHz	QPSK	26683	6RB#0	NV	20	-5.98	-0.003124	±2.5	PASS
Band2 5	1.4MHz	16QAM	26047	6RB#0	NV	-30	-4.16	-0.002248	±2.5	PASS
Band2 5	1.4MHz	16QAM	26047	6RB#0	NV	-20	-6.75	-0.003647	±2.5	PASS
Band2 5	1.4MHz	16QAM	26047	6RB#0	NV	0	-5.59	-0.003020	±2.5	PASS
Band2 5	1.4MHz	16QAM	26047	6RB#0	NV	10	-6.31	-0.003410	±2.5	PASS
Band2 5	1.4MHz	16QAM	26047	6RB#0	NV	20	-5.84	-0.003156	±2.5	PASS
Band2 5	1.4MHz	16QAM	26365	6RB#0	NV	-30	5.51	0.002927	±2.5	PASS
Band2 5	1.4MHz	16QAM	26365	6RB#0	NV	-20	4.25	0.002258	±2.5	PASS
Band2 5	1.4MHz	16QAM	26365	6RB#0	NV	0	3.13	0.001663	±2.5	PASS
Band2 5	1.4MHz	16QAM	26365	6RB#0	NV	10	-3.78	-0.002008	±2.5	PASS
Band2 5	1.4MHz	16QAM	26365	6RB#0	NV	20	-2.53	-0.001344	±2.5	PASS
Band2 5	1.4MHz	16QAM	26683	6RB#0	NV	-30	-5.04	-0.002633	±2.5	PASS
Band2 5	1.4MHz	16QAM	26683	6RB#0	NV	-20	-5.14	-0.002685	±2.5	PASS
Band2 5	1.4MHz	16QAM	26683	6RB#0	NV	0	-5.12	-0.002675	±2.5	PASS
Band2 5	1.4MHz	16QAM	26683	6RB#0	NV	10	-4.51	-0.002356	±2.5	PASS
Band2 5	1.4MHz	16QAM	26683	6RB#0	NV	20	-5.69	-0.002972	±2.5	PASS
Band2 5	3MHz	QPSK	26055	15RB#0	NV	-30	-5.26	-0.002841	±2.5	PASS
Band2 5	3MHz	QPSK	26055	15RB#0	NV	-20	-3.71	-0.002004	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

5										
Band2 5	3MHz	QPSK	26055	15RB#0	NV	0	-5.24	-0.002830	±2.5	PASS
Band2 5	3MHz	QPSK	26055	15RB#0	NV	10	-3.53	-0.001907	±2.5	PASS
Band2 5	3MHz	QPSK	26055	15RB#0	NV	20	-3.93	-0.002123	±2.5	PASS
Band2 5	3MHz	QPSK	26365	15RB#0	NV	-30	2.59	0.001376	±2.5	PASS
Band2 5	3MHz	QPSK	26365	15RB#0	NV	-20	3.45	0.001833	±2.5	PASS
Band2 5	3MHz	QPSK	26365	15RB#0	NV	0	-4.08	-0.002167	±2.5	PASS
Band2 5	3MHz	QPSK	26365	15RB#0	NV	10	6.31	0.003352	±2.5	PASS
Band2 5	3MHz	QPSK	26365	15RB#0	NV	20	-4.23	-0.002247	±2.5	PASS
Band2 5	3MHz	QPSK	26675	15RB#0	NV	-30	-5.55	-0.002900	±2.5	PASS
Band2 5	3MHz	QPSK	26675	15RB#0	NV	-20	-8.94	-0.004672	±2.5	PASS
Band2 5	3MHz	QPSK	26675	15RB#0	NV	0	-5.98	-0.003125	±2.5	PASS
Band2 5	3MHz	QPSK	26675	15RB#0	NV	10	-7.55	-0.003946	±2.5	PASS
Band2 5	3MHz	QPSK	26675	15RB#0	NV	20	-4.65	-0.002430	±2.5	PASS
Band2 5	3MHz	16QAM	26055	15RB#0	NV	-30	-5.32	-0.002873	±2.5	PASS
Band2 5	3MHz	16QAM	26055	15RB#0	NV	-20	-5.09	-0.002749	±2.5	PASS
Band2 5	3MHz	16QAM	26055	15RB#0	NV	0	-5.52	-0.002981	±2.5	PASS
Band2 5	3MHz	16QAM	26055	15RB#0	NV	10	-7.04	-0.003802	±2.5	PASS
Band2 5	3MHz	16QAM	26055	15RB#0	NV	20	-4.52	-0.002441	±2.5	PASS
Band2 5	3MHz	16QAM	26365	15RB#0	NV	-30	-4.36	-0.002316	±2.5	PASS
Band2 5	3MHz	16QAM	26365	15RB#0	NV	-20	-5.88	-0.003124	±2.5	PASS
Band2	3MHz	16QAM	26365	15RB#0	NV	0	4.84	0.002571	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

5										
Band2 5	3MHz	16QAM	26365	15RB#0	NV	10	-2.45	-0.001301	±2.5	PASS
Band2 5	3MHz	16QAM	26365	15RB#0	NV	20	-3.06	-0.001625	±2.5	PASS
Band2 5	3MHz	16QAM	26675	15RB#0	NV	-30	-9.67	-0.005054	±2.5	PASS
Band2 5	3MHz	16QAM	26675	15RB#0	NV	-20	-7.94	-0.004149	±2.5	PASS
Band2 5	3MHz	16QAM	26675	15RB#0	NV	0	-5.62	-0.002937	±2.5	PASS
Band2 5	3MHz	16QAM	26675	15RB#0	NV	10	-4.98	-0.002603	±2.5	PASS
Band2 5	3MHz	16QAM	26675	15RB#0	NV	20	-4.92	-0.002571	±2.5	PASS
Band2 5	5MHz	QPSK	26065	25RB#0	NV	-30	-4.86	-0.002623	±2.5	PASS
Band2 5	5MHz	QPSK	26065	25RB#0	NV	-20	-5.31	-0.002866	±2.5	PASS
Band2 5	5MHz	QPSK	26065	25RB#0	NV	0	2.89	0.001560	±2.5	PASS
Band2 5	5MHz	QPSK	26065	25RB#0	NV	10	-3.46	-0.001868	±2.5	PASS
Band2 5	5MHz	QPSK	26065	25RB#0	NV	20	-4.95	-0.002672	±2.5	PASS
Band2 5	5MHz	QPSK	26365	25RB#0	NV	-30	3.50	0.001859	±2.5	PASS
Band2 5	5MHz	QPSK	26365	25RB#0	NV	-20	5.06	0.002688	±2.5	PASS
Band2 5	5MHz	QPSK	26365	25RB#0	NV	0	3.42	0.001817	±2.5	PASS
Band2 5	5MHz	QPSK	26365	25RB#0	NV	10	2.29	0.001216	±2.5	PASS
Band2 5	5MHz	QPSK	26365	25RB#0	NV	20	3.83	0.002035	±2.5	PASS
Band2 5	5MHz	QPSK	26665	25RB#0	NV	-30	-8.35	-0.004366	±2.5	PASS
Band2 5	5MHz	QPSK	26665	25RB#0	NV	-20	-7.72	-0.004037	±2.5	PASS
Band2 5	5MHz	QPSK	26665	25RB#0	NV	0	-5.34	-0.002792	±2.5	PASS
Band2	5MHz	QPSK	26665	25RB#0	NV	10	-6.69	-0.003498	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

5										
Band2 5	5MHz	QPSK	26665	25RB#0	NV	20	-7.24	-0.003786	±2.5	PASS
Band2 5	5MHz	16QAM	26065	25RB#0	NV	-30	-5.98	-0.003228	±2.5	PASS
Band2 5	5MHz	16QAM	26065	25RB#0	NV	-20	-5.11	-0.002758	±2.5	PASS
Band2 5	5MHz	16QAM	26065	25RB#0	NV	0	4.05	0.002186	±2.5	PASS
Band2 5	5MHz	16QAM	26065	25RB#0	NV	10	-4.78	-0.002580	±2.5	PASS
Band2 5	5MHz	16QAM	26065	25RB#0	NV	20	-4.51	-0.002435	±2.5	PASS
Band2 5	5MHz	16QAM	26365	25RB#0	NV	-30	-4.19	-0.002226	±2.5	PASS
Band2 5	5MHz	16QAM	26365	25RB#0	NV	-20	3.85	0.002045	±2.5	PASS
Band2 5	5MHz	16QAM	26365	25RB#0	NV	0	-6.59	-0.003501	±2.5	PASS
Band2 5	5MHz	16QAM	26365	25RB#0	NV	10	-3.95	-0.002098	±2.5	PASS
Band2 5	5MHz	16QAM	26365	25RB#0	NV	20	4.12	0.002189	±2.5	PASS
Band2 5	5MHz	16QAM	26665	25RB#0	NV	-30	-7.58	-0.003963	±2.5	PASS
Band2 5	5MHz	16QAM	26665	25RB#0	NV	-20	-5.79	-0.003027	±2.5	PASS
Band2 5	5MHz	16QAM	26665	25RB#0	NV	0	-6.88	-0.003597	±2.5	PASS
Band2 5	5MHz	16QAM	26665	25RB#0	NV	10	-7.18	-0.003754	±2.5	PASS
Band2 5	5MHz	16QAM	26665	25RB#0	NV	20	-8.83	-0.004617	±2.5	PASS
Band2 5	10MHz	QPSK	26090	50RB#0	NV	-30	-8.07	-0.004350	±2.5	PASS
Band2 5	10MHz	QPSK	26090	50RB#0	NV	-20	-8.57	-0.004620	±2.5	PASS
Band2 5	10MHz	QPSK	26090	50RB#0	NV	0	-7.07	-0.003811	±2.5	PASS
Band2 5	10MHz	QPSK	26090	50RB#0	NV	10	-5.42	-0.002922	±2.5	PASS
Band2	10MHz	QPSK	26090	50RB#0	NV	20	-6.82	-0.003677	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

5										
Band2 5	10MHz	QPSK	26365	50RB#0	NV	-30	3.15	0.001673	±2.5	PASS
Band2 5	10MHz	QPSK	26365	50RB#0	NV	-20	4.41	0.002343	±2.5	PASS
Band2 5	10MHz	QPSK	26365	50RB#0	NV	0	3.40	0.001806	±2.5	PASS
Band2 5	10MHz	QPSK	26365	50RB#0	NV	10	-5.25	-0.002789	±2.5	PASS
Band2 5	10MHz	QPSK	26365	50RB#0	NV	20	4.26	0.002263	±2.5	PASS
Band2 5	10MHz	QPSK	26640	50RB#0	NV	-30	-5.56	-0.002911	±2.5	PASS
Band2 5	10MHz	QPSK	26640	50RB#0	NV	-20	-5.58	-0.002921	±2.5	PASS
Band2 5	10MHz	QPSK	26640	50RB#0	NV	0	-4.73	-0.002476	±2.5	PASS
Band2 5	10MHz	QPSK	26640	50RB#0	NV	10	-5.65	-0.002958	±2.5	PASS
Band2 5	10MHz	QPSK	26640	50RB#0	NV	20	-5.18	-0.002712	±2.5	PASS
Band2 5	10MHz	16QAM	26090	50RB#0	NV	-30	-8.50	-0.004582	±2.5	PASS
Band2 5	10MHz	16QAM	26090	50RB#0	NV	-20	-6.49	-0.003499	±2.5	PASS
Band2 5	10MHz	16QAM	26090	50RB#0	NV	0	-6.88	-0.003709	±2.5	PASS
Band2 5	10MHz	16QAM	26090	50RB#0	NV	10	-8.11	-0.004372	±2.5	PASS
Band2 5	10MHz	16QAM	26090	50RB#0	NV	20	-5.14	-0.002771	±2.5	PASS
Band2 5	10MHz	16QAM	26365	50RB#0	NV	-30	6.11	0.003246	±2.5	PASS
Band2 5	10MHz	16QAM	26365	50RB#0	NV	-20	-3.63	-0.001928	±2.5	PASS
Band2 5	10MHz	16QAM	26365	50RB#0	NV	0	3.33	0.001769	±2.5	PASS
Band2 5	10MHz	16QAM	26365	50RB#0	NV	10	-3.10	-0.001647	±2.5	PASS
Band2 5	10MHz	16QAM	26365	50RB#0	NV	20	3.50	0.001859	±2.5	PASS
Band2	10MHz	16QAM	26640	50RB#0	NV	-30	-4.78	-0.002503	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

5										
Band2 5	10MHz	16QAM	26640	50RB#0	NV	-20	-5.34	-0.002796	±2.5	PASS
Band2 5	10MHz	16QAM	26640	50RB#0	NV	0	-4.72	-0.002471	±2.5	PASS
Band2 5	10MHz	16QAM	26640	50RB#0	NV	10	-6.14	-0.003215	±2.5	PASS
Band2 5	10MHz	16QAM	26640	50RB#0	NV	20	-4.23	-0.002215	±2.5	PASS
Band2 5	15MHz	QPSK	26115	75RB#0	NV	-30	-4.84	-0.002606	±2.5	PASS
Band2 5	15MHz	QPSK	26115	75RB#0	NV	-20	-6.45	-0.003472	±2.5	PASS
Band2 5	15MHz	QPSK	26115	75RB#0	NV	0	-4.95	-0.002665	±2.5	PASS
Band2 5	15MHz	QPSK	26115	75RB#0	NV	10	-5.94	-0.003198	±2.5	PASS
Band2 5	15MHz	QPSK	26115	75RB#0	NV	20	-8.53	-0.004592	±2.5	PASS
Band2 5	15MHz	QPSK	26365	75RB#0	NV	-30	5.36	0.002847	±2.5	PASS
Band2 5	15MHz	QPSK	26365	75RB#0	NV	-20	-3.06	-0.001625	±2.5	PASS
Band2 5	15MHz	QPSK	26365	75RB#0	NV	0	-2.62	-0.001392	±2.5	PASS
Band2 5	15MHz	QPSK	26365	75RB#0	NV	10	3.81	0.002024	±2.5	PASS
Band2 5	15MHz	QPSK	26365	75RB#0	NV	20	4.52	0.002401	±2.5	PASS
Band2 5	15MHz	QPSK	26615	75RB#0	NV	-30	-4.98	-0.002611	±2.5	PASS
Band2 5	15MHz	QPSK	26615	75RB#0	NV	-20	-4.01	-0.002102	±2.5	PASS
Band2 5	15MHz	QPSK	26615	75RB#0	NV	0	-4.49	-0.002354	±2.5	PASS
Band2 5	15MHz	QPSK	26615	75RB#0	NV	10	-5.79	-0.003035	±2.5	PASS
Band2 5	15MHz	QPSK	26615	75RB#0	NV	20	-4.25	-0.002228	±2.5	PASS
Band2 5	15MHz	16QAM	26115	75RB#0	NV	-30	-10.06	-0.005416	±2.5	PASS
Band2	15MHz	16QAM	26115	75RB#0	NV	-20	-6.58	-0.003542	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

5										
Band2 5	15MHz	16QAM	26115	75RB#0	NV	0	-7.75	-0.004172	±2.5	PASS
Band2 5	15MHz	16QAM	26115	75RB#0	NV	10	-8.88	-0.004781	±2.5	PASS
Band2 5	15MHz	16QAM	26115	75RB#0	NV	20	-8.65	-0.004657	±2.5	PASS
Band2 5	15MHz	16QAM	26365	75RB#0	NV	-30	4.48	0.002380	±2.5	PASS
Band2 5	15MHz	16QAM	26365	75RB#0	NV	-20	-3.71	-0.001971	±2.5	PASS
Band2 5	15MHz	16QAM	26365	75RB#0	NV	0	3.60	0.001912	±2.5	PASS
Band2 5	15MHz	16QAM	26365	75RB#0	NV	10	5.21	0.002768	±2.5	PASS
Band2 5	15MHz	16QAM	26365	75RB#0	NV	20	-5.14	-0.002730	±2.5	PASS
Band2 5	15MHz	16QAM	26615	75RB#0	NV	-30	4.61	0.002417	±2.5	PASS
Band2 5	15MHz	16QAM	26615	75RB#0	NV	-20	-4.02	-0.002107	±2.5	PASS
Band2 5	15MHz	16QAM	26615	75RB#0	NV	0	-3.78	-0.001982	±2.5	PASS
Band2 5	15MHz	16QAM	26615	75RB#0	NV	10	4.06	0.002128	±2.5	PASS
Band2 5	15MHz	16QAM	26615	75RB#0	NV	20	-4.94	-0.002590	±2.5	PASS
Band2 5	20MHz	QPSK	26140	100RB#0	NV	-30	4.15	0.002231	±2.5	PASS
Band2 5	20MHz	QPSK	26140	100RB#0	NV	-20	2.99	0.001608	±2.5	PASS
Band2 5	20MHz	QPSK	26140	100RB#0	NV	0	-3.55	-0.001909	±2.5	PASS
Band2 5	20MHz	QPSK	26140	100RB#0	NV	10	2.73	0.001468	±2.5	PASS
Band2 5	20MHz	QPSK	26140	100RB#0	NV	20	2.56	0.001376	±2.5	PASS
Band2 5	20MHz	QPSK	26365	100RB#0	NV	-30	3.12	0.001657	±2.5	PASS
Band2 5	20MHz	QPSK	26365	100RB#0	NV	-20	4.91	0.002608	±2.5	PASS
Band2	20MHz	QPSK	26365	100RB#0	NV	0	4.29	0.002279	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

5										
Band2 5	20MHz	QPSK	26365	100RB#0	NV	10	3.25	0.001726	±2.5	PASS
Band2 5	20MHz	QPSK	26365	100RB#0	NV	20	6.07	0.003224	±2.5	PASS
Band2 5	20MHz	QPSK	26590	100RB#0	NV	-30	3.73	0.001958	±2.5	PASS
Band2 5	20MHz	QPSK	26590	100RB#0	NV	-20	3.12	0.001638	±2.5	PASS
Band2 5	20MHz	QPSK	26590	100RB#0	NV	0	-3.63	-0.001906	±2.5	PASS
Band2 5	20MHz	QPSK	26590	100RB#0	NV	10	-4.31	-0.002262	±2.5	PASS
Band2 5	20MHz	QPSK	26590	100RB#0	NV	20	5.46	0.002866	±2.5	PASS
Band2 5	20MHz	16QAM	26140	100RB#0	NV	-30	2.43	0.001306	±2.5	PASS
Band2 5	20MHz	16QAM	26140	100RB#0	NV	-20	3.39	0.001823	±2.5	PASS
Band2 5	20MHz	16QAM	26140	100RB#0	NV	0	4.18	0.002247	±2.5	PASS
Band2 5	20MHz	16QAM	26140	100RB#0	NV	10	3.83	0.002059	±2.5	PASS
Band2 5	20MHz	16QAM	26140	100RB#0	NV	20	3.19	0.001715	±2.5	PASS
Band2 5	20MHz	16QAM	26365	100RB#0	NV	-30	5.29	0.002810	±2.5	PASS
Band2 5	20MHz	16QAM	26365	100RB#0	NV	-20	4.73	0.002513	±2.5	PASS
Band2 5	20MHz	16QAM	26365	100RB#0	NV	0	3.30	0.001753	±2.5	PASS
Band2 5	20MHz	16QAM	26365	100RB#0	NV	10	6.90	0.003665	±2.5	PASS
Band2 5	20MHz	16QAM	26365	100RB#0	NV	20	-2.55	-0.001355	±2.5	PASS
Band2 5	20MHz	16QAM	26590	100RB#0	NV	-30	4.15	0.002178	±2.5	PASS
Band2 5	20MHz	16QAM	26590	100RB#0	NV	-20	4.51	0.002367	±2.5	PASS
Band2 5	20MHz	16QAM	26590	100RB#0	NV	0	2.86	0.001501	±2.5	PASS
Band2	20MHz	16QAM	26590	100RB#0	NV	10	4.62	0.002425	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

5										
Band2 5	20MHz	16QAM	26590	100RB#0	NV	20	4.06	0.002131	±2.5	PASS
Band2 6	1.4MHz	QPSK	26797	6RB#0	NV	-30	-4.82	-0.005845	±2.5	PASS
Band2 6	1.4MHz	QPSK	26797	6RB#0	NV	-20	-4.42	-0.005360	±2.5	PASS
Band2 6	1.4MHz	QPSK	26797	6RB#0	NV	0	-1.96	-0.002377	±2.5	PASS
Band2 6	1.4MHz	QPSK	26797	6RB#0	NV	10	-3.15	-0.003820	±2.5	PASS
Band2 6	1.4MHz	QPSK	26797	6RB#0	NV	20	-3.15	-0.003820	±2.5	PASS
Band2 6	1.4MHz	QPSK	26915	6RB#0	NV	-30	-4.11	-0.004913	±2.5	PASS
Band2 6	1.4MHz	QPSK	26915	6RB#0	NV	-20	-3.08	-0.003682	±2.5	PASS
Band2 6	1.4MHz	QPSK	26915	6RB#0	NV	0	-2.19	-0.002618	±2.5	PASS
Band2 6	1.4MHz	QPSK	26915	6RB#0	NV	10	-2.42	-0.002893	±2.5	PASS
Band2 6	1.4MHz	QPSK	26915	6RB#0	NV	20	1.83	0.002188	±2.5	PASS
Band2 6	1.4MHz	QPSK	27033	6RB#0	NV	-30	-1.80	-0.002122	±2.5	PASS
Band2 6	1.4MHz	QPSK	27033	6RB#0	NV	-20	-1.83	-0.002157	±2.5	PASS
Band2 6	1.4MHz	QPSK	27033	6RB#0	NV	0	2.40	0.002829	±2.5	PASS
Band2 6	1.4MHz	QPSK	27033	6RB#0	NV	10	-3.58	-0.004220	±2.5	PASS
Band2 6	1.4MHz	QPSK	27033	6RB#0	NV	20	-2.56	-0.003018	±2.5	PASS
Band2 6	1.4MHz	16QAM	26797	6RB#0	NV	-30	-4.81	-0.005832	±2.5	PASS
Band2 6	1.4MHz	16QAM	26797	6RB#0	NV	-20	-3.16	-0.003832	±2.5	PASS
Band2 6	1.4MHz	16QAM	26797	6RB#0	NV	0	-3.26	-0.003953	±2.5	PASS
Band2 6	1.4MHz	16QAM	26797	6RB#0	NV	10	-3.15	-0.003820	±2.5	PASS
Band2	1.4MHz	16QAM	26797	6RB#0	NV	20	-3.23	-0.003917	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

6										
Band2 6	1.4MHz	16QAM	26915	6RB#0	NV	-30	-3.71	-0.004435	±2.5	PASS
Band2 6	1.4MHz	16QAM	26915	6RB#0	NV	-20	-3.49	-0.004172	±2.5	PASS
Band2 6	1.4MHz	16QAM	26915	6RB#0	NV	0	-3.28	-0.003921	±2.5	PASS
Band2 6	1.4MHz	16QAM	26915	6RB#0	NV	10	-2.43	-0.002905	±2.5	PASS
Band2 6	1.4MHz	16QAM	26915	6RB#0	NV	20	-3.63	-0.004340	±2.5	PASS
Band2 6	1.4MHz	16QAM	27033	6RB#0	NV	-30	-1.83	-0.002157	±2.5	PASS
Band2 6	1.4MHz	16QAM	27033	6RB#0	NV	-20	-2.15	-0.002534	±2.5	PASS
Band2 6	1.4MHz	16QAM	27033	6RB#0	NV	0	2.37	0.002794	±2.5	PASS
Band2 6	1.4MHz	16QAM	27033	6RB#0	NV	10	-1.59	-0.001874	±2.5	PASS
Band2 6	1.4MHz	16QAM	27033	6RB#0	NV	20	2.23	0.002629	±2.5	PASS
Band2 6	3MHz	QPSK	26805	15RB#0	NV	-30	-1.57	-0.001902	±2.5	PASS
Band2 6	3MHz	QPSK	26805	15RB#0	NV	-20	1.89	0.002290	±2.5	PASS
Band2 6	3MHz	QPSK	26805	15RB#0	NV	0	2.03	0.002459	±2.5	PASS
Band2 6	3MHz	QPSK	26805	15RB#0	NV	10	-2.69	-0.003259	±2.5	PASS
Band2 6	3MHz	QPSK	26805	15RB#0	NV	20	-1.97	-0.002386	±2.5	PASS
Band2 6	3MHz	QPSK	26915	15RB#0	NV	-30	-3.88	-0.004638	±2.5	PASS
Band2 6	3MHz	QPSK	26915	15RB#0	NV	-20	-3.08	-0.003682	±2.5	PASS
Band2 6	3MHz	QPSK	26915	15RB#0	NV	0	-4.65	-0.005559	±2.5	PASS
Band2 6	3MHz	QPSK	26915	15RB#0	NV	10	-3.43	-0.004100	±2.5	PASS
Band2 6	3MHz	QPSK	26915	15RB#0	NV	20	-3.42	-0.004088	±2.5	PASS
Band2	3MHz	QPSK	27025	15RB#0	NV	-30	-4.12	-0.004861	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

6										
Band2 6	3MHz	QPSK	27025	15RB#0	NV	-20	-4.59	-0.005416	±2.5	PASS
Band2 6	3MHz	QPSK	27025	15RB#0	NV	0	-4.18	-0.004932	±2.5	PASS
Band2 6	3MHz	QPSK	27025	15RB#0	NV	10	-3.88	-0.004578	±2.5	PASS
Band2 6	3MHz	QPSK	27025	15RB#0	NV	20	-3.60	-0.004248	±2.5	PASS
Band2 6	3MHz	16QAM	26805	15RB#0	NV	-30	-3.03	-0.003671	±2.5	PASS
Band2 6	3MHz	16QAM	26805	15RB#0	NV	-20	1.63	0.001975	±2.5	PASS
Band2 6	3MHz	16QAM	26805	15RB#0	NV	0	-3.16	-0.003828	±2.5	PASS
Band2 6	3MHz	16QAM	26805	15RB#0	NV	10	2.25	0.002726	±2.5	PASS
Band2 6	3MHz	16QAM	26805	15RB#0	NV	20	-3.56	-0.004313	±2.5	PASS
Band2 6	3MHz	16QAM	26915	15RB#0	NV	-30	3.03	0.003622	±2.5	PASS
Band2 6	3MHz	16QAM	26915	15RB#0	NV	-20	2.62	0.003132	±2.5	PASS
Band2 6	3MHz	16QAM	26915	15RB#0	NV	0	-2.72	-0.003252	±2.5	PASS
Band2 6	3MHz	16QAM	26915	15RB#0	NV	10	-2.42	-0.002893	±2.5	PASS
Band2 6	3MHz	16QAM	26915	15RB#0	NV	20	-2.90	-0.003467	±2.5	PASS
Band2 6	3MHz	16QAM	27025	15RB#0	NV	-30	-3.91	-0.004614	±2.5	PASS
Band2 6	3MHz	16QAM	27025	15RB#0	NV	-20	-4.21	-0.004968	±2.5	PASS
Band2 6	3MHz	16QAM	27025	15RB#0	NV	0	-1.80	-0.002124	±2.5	PASS
Band2 6	3MHz	16QAM	27025	15RB#0	NV	10	-2.60	-0.003068	±2.5	PASS
Band2 6	3MHz	16QAM	27025	15RB#0	NV	20	-5.62	-0.006631	±2.5	PASS
Band2 6	5MHz	QPSK	26815	25RB#0	NV	-30	-3.45	-0.004174	±2.5	PASS
Band2 6	5MHz	QPSK	26815	25RB#0	NV	-20	-2.53	-0.003061	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

6										
Band2 6	5MHz	QPSK	26815	25RB#0	NV	0	-4.84	-0.005856	±2.5	PASS
Band2 6	5MHz	QPSK	26815	25RB#0	NV	10	-4.06	-0.004912	±2.5	PASS
Band2 6	5MHz	QPSK	26815	25RB#0	NV	20	-3.66	-0.004428	±2.5	PASS
Band2 6	5MHz	QPSK	26915	25RB#0	NV	-30	-4.61	-0.005511	±2.5	PASS
Band2 6	5MHz	QPSK	26915	25RB#0	NV	-20	-1.50	-0.001793	±2.5	PASS
Band2 6	5MHz	QPSK	26915	25RB#0	NV	0	-3.10	-0.003706	±2.5	PASS
Band2 6	5MHz	QPSK	26915	25RB#0	NV	10	-1.50	-0.001793	±2.5	PASS
Band2 6	5MHz	QPSK	26915	25RB#0	NV	20	-2.68	-0.003204	±2.5	PASS
Band2 6	5MHz	QPSK	27015	25RB#0	NV	-30	-2.17	-0.002563	±2.5	PASS
Band2 6	5MHz	QPSK	27015	25RB#0	NV	-20	-3.09	-0.003650	±2.5	PASS
Band2 6	5MHz	QPSK	27015	25RB#0	NV	0	-4.03	-0.004761	±2.5	PASS
Band2 6	5MHz	QPSK	27015	25RB#0	NV	10	-3.89	-0.004595	±2.5	PASS
Band2 6	5MHz	QPSK	27015	25RB#0	NV	20	-1.89	-0.002233	±2.5	PASS
Band2 6	5MHz	16QAM	26815	25RB#0	NV	-30	-3.53	-0.004271	±2.5	PASS
Band2 6	5MHz	16QAM	26815	25RB#0	NV	-20	-1.72	-0.002081	±2.5	PASS
Band2 6	5MHz	16QAM	26815	25RB#0	NV	0	-2.46	-0.002976	±2.5	PASS
Band2 6	5MHz	16QAM	26815	25RB#0	NV	10	-2.10	-0.002541	±2.5	PASS
Band2 6	5MHz	16QAM	26815	25RB#0	NV	20	-3.86	-0.004670	±2.5	PASS
Band2 6	5MHz	16QAM	26915	25RB#0	NV	-30	-2.15	-0.002570	±2.5	PASS
Band2 6	5MHz	16QAM	26915	25RB#0	NV	-20	-3.02	-0.003610	±2.5	PASS
Band2	5MHz	16QAM	26915	25RB#0	NV	0	-2.33	-0.002785	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

6										
Band2 6	5MHz	16QAM	26915	25RB#0	NV	10	-2.82	-0.003371	±2.5	PASS
Band2 6	5MHz	16QAM	26915	25RB#0	NV	20	-3.26	-0.003897	±2.5	PASS
Band2 6	5MHz	16QAM	27015	25RB#0	NV	-30	-2.36	-0.002788	±2.5	PASS
Band2 6	5MHz	16QAM	27015	25RB#0	NV	-20	-3.15	-0.003721	±2.5	PASS
Band2 6	5MHz	16QAM	27015	25RB#0	NV	0	-2.50	-0.002953	±2.5	PASS
Band2 6	5MHz	16QAM	27015	25RB#0	NV	10	1.69	0.001996	±2.5	PASS
Band2 6	5MHz	16QAM	27015	25RB#0	NV	20	-2.66	-0.003142	±2.5	PASS
Band2 6	10MHz	QPSK	26840	50RB#0	NV	-30	-2.56	-0.003088	±2.5	PASS
Band2 6	10MHz	QPSK	26840	50RB#0	NV	-20	-2.13	-0.002569	±2.5	PASS
Band2 6	10MHz	QPSK	26840	50RB#0	NV	0	-1.95	-0.002352	±2.5	PASS
Band2 6	10MHz	QPSK	26840	50RB#0	NV	10	2.85	0.003438	±2.5	PASS
Band2 6	10MHz	QPSK	26840	50RB#0	NV	20	1.96	0.002364	±2.5	PASS
Band2 6	10MHz	QPSK	26915	50RB#0	NV	-30	-4.59	-0.005487	±2.5	PASS
Band2 6	10MHz	QPSK	26915	50RB#0	NV	-20	-2.23	-0.002666	±2.5	PASS
Band2 6	10MHz	QPSK	26915	50RB#0	NV	0	-3.59	-0.004292	±2.5	PASS
Band2 6	10MHz	QPSK	26915	50RB#0	NV	10	-4.33	-0.005176	±2.5	PASS
Band2 6	10MHz	QPSK	26915	50RB#0	NV	20	-2.39	-0.002857	±2.5	PASS
Band2 6	10MHz	QPSK	26990	50RB#0	NV	-30	-4.05	-0.004799	±2.5	PASS
Band2 6	10MHz	QPSK	26990	50RB#0	NV	-20	-3.12	-0.003697	±2.5	PASS
Band2 6	10MHz	QPSK	26990	50RB#0	NV	0	1.82	0.002156	±2.5	PASS
Band2	10MHz	QPSK	26990	50RB#0	NV	10	-1.95	-0.002310	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

6										
Band2 6	10MHz	QPSK	26990	50RB#0	NV	20	-3.25	-0.003851	±2.5	PASS
Band2 6	10MHz	16QAM	26840	50RB#0	NV	-30	-2.90	-0.003498	±2.5	PASS
Band2 6	10MHz	16QAM	26840	50RB#0	NV	-20	-1.66	-0.002002	±2.5	PASS
Band2 6	10MHz	16QAM	26840	50RB#0	NV	0	-2.13	-0.002569	±2.5	PASS
Band2 6	10MHz	16QAM	26840	50RB#0	NV	10	-3.56	-0.004294	±2.5	PASS
Band2 6	10MHz	16QAM	26840	50RB#0	NV	20	-2.75	-0.003317	±2.5	PASS
Band2 6	10MHz	16QAM	26915	50RB#0	NV	-30	-1.12	-0.001339	±2.5	PASS
Band2 6	10MHz	16QAM	26915	50RB#0	NV	-20	-3.20	-0.003825	±2.5	PASS
Band2 6	10MHz	16QAM	26915	50RB#0	NV	0	-1.73	-0.002068	±2.5	PASS
Band2 6	10MHz	16QAM	26915	50RB#0	NV	10	-2.29	-0.002738	±2.5	PASS
Band2 6	10MHz	16QAM	26915	50RB#0	NV	20	-3.32	-0.003969	±2.5	PASS
Band2 6	10MHz	16QAM	26990	50RB#0	NV	-30	-2.89	-0.003424	±2.5	PASS
Band2 6	10MHz	16QAM	26990	50RB#0	NV	-20	-4.58	-0.005427	±2.5	PASS
Band2 6	10MHz	16QAM	26990	50RB#0	NV	0	2.98	0.003531	±2.5	PASS
Band2 6	10MHz	16QAM	26990	50RB#0	NV	10	-2.82	-0.003341	±2.5	PASS
Band2 6	10MHz	16QAM	26990	50RB#0	NV	20	-3.66	-0.004336	±2.5	PASS
Band2 6	15MHz	QPSK	26865	75RB#0	NV	-30	2.92	0.003512	±2.5	PASS
Band2 6	15MHz	QPSK	26865	75RB#0	NV	-20	2.17	0.002610	±2.5	PASS
Band2 6	15MHz	QPSK	26865	75RB#0	NV	0	-2.65	-0.003187	±2.5	PASS
Band2 6	15MHz	QPSK	26865	75RB#0	NV	10	1.92	0.002309	±2.5	PASS
Band2	15MHz	QPSK	26865	75RB#0	NV	20	1.90	0.002285	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

6										
Band2 6	15MHz	QPSK	26915	75RB#0	NV	-30	1.54	0.001841	±2.5	PASS
Band2 6	15MHz	QPSK	26915	75RB#0	NV	-20	-2.09	-0.002499	±2.5	PASS
Band2 6	15MHz	QPSK	26915	75RB#0	NV	0	-2.29	-0.002738	±2.5	PASS
Band2 6	15MHz	QPSK	26915	75RB#0	NV	10	-1.83	-0.002188	±2.5	PASS
Band2 6	15MHz	QPSK	26915	75RB#0	NV	20	-1.95	-0.002331	±2.5	PASS
Band2 6	15MHz	QPSK	26965	75RB#0	NV	-30	-3.20	-0.003803	±2.5	PASS
Band2 6	15MHz	QPSK	26965	75RB#0	NV	-20	-4.55	-0.005407	±2.5	PASS
Band2 6	15MHz	QPSK	26965	75RB#0	NV	0	-3.32	-0.003945	±2.5	PASS
Band2 6	15MHz	QPSK	26965	75RB#0	NV	10	-2.36	-0.002805	±2.5	PASS
Band2 6	15MHz	QPSK	26965	75RB#0	NV	20	-2.89	-0.003434	±2.5	PASS
Band2 6	15MHz	16QAM	26865	75RB#0	NV	-30	2.25	0.002706	±2.5	PASS
Band2 6	15MHz	16QAM	26865	75RB#0	NV	-20	-3.56	-0.004281	±2.5	PASS
Band2 6	15MHz	16QAM	26865	75RB#0	NV	0	-3.98	-0.004787	±2.5	PASS
Band2 6	15MHz	16QAM	26865	75RB#0	NV	10	-1.80	-0.002165	±2.5	PASS
Band2 6	15MHz	16QAM	26865	75RB#0	NV	20	-2.43	-0.002922	±2.5	PASS
Band2 6	15MHz	16QAM	26915	75RB#0	NV	-30	-2.43	-0.002905	±2.5	PASS
Band2 6	15MHz	16QAM	26915	75RB#0	NV	-20	2.85	0.003407	±2.5	PASS
Band2 6	15MHz	16QAM	26915	75RB#0	NV	0	-2.15	-0.002570	±2.5	PASS
Band2 6	15MHz	16QAM	26915	75RB#0	NV	10	2.29	0.002738	±2.5	PASS
Band2 6	15MHz	16QAM	26915	75RB#0	NV	20	-3.18	-0.003802	±2.5	PASS
Band2	15MHz	16QAM	26965	75RB#0	NV	-30	-4.16	-0.004944	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

6										
Band2 6	15MHz	16QAM	26965	75RB#0	NV	-20	-2.68	-0.003185	±2.5	PASS
Band2 6	15MHz	16QAM	26965	75RB#0	NV	0	-3.19	-0.003791	±2.5	PASS
Band2 6	15MHz	16QAM	26965	75RB#0	NV	10	-3.68	-0.004373	±2.5	PASS
Band2 6	15MHz	16QAM	26965	75RB#0	NV	20	-4.94	-0.005870	±2.5	PASS

---End---