




## 11AC40MIMO\_5755\_30~5650

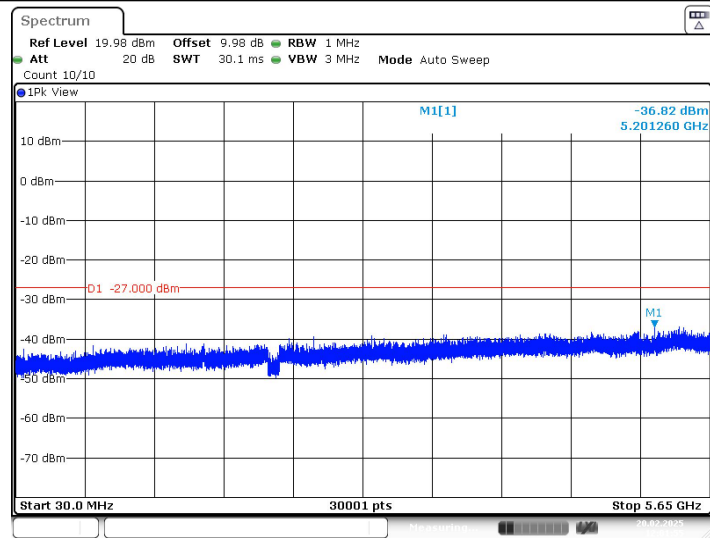


## 11AC40MIMO\_5755\_5925~40000

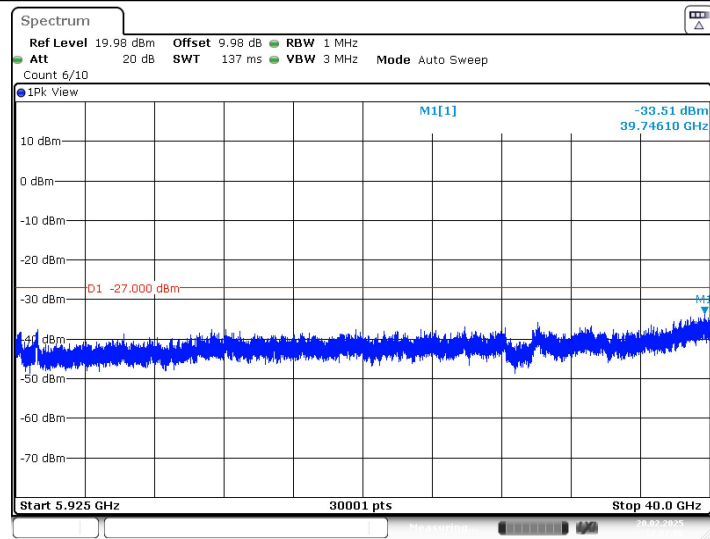


## 11AC40MIMO\_5795\_30~5650

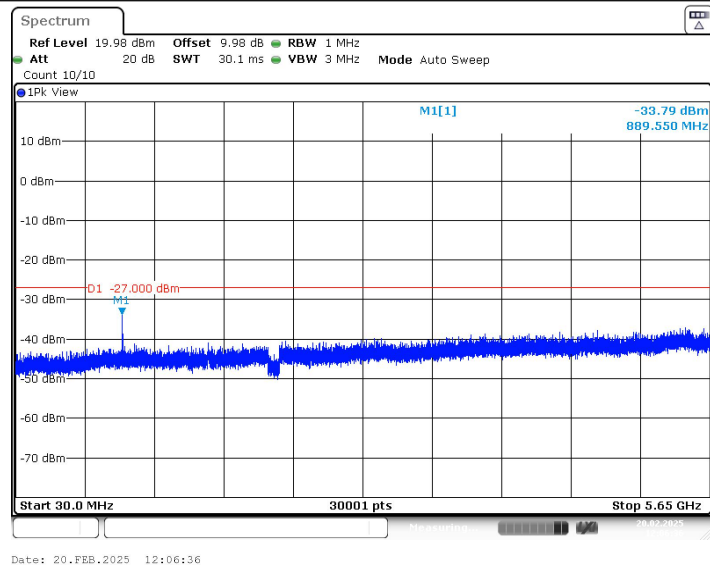


11AC40MIMO\_5795\_5925~40000

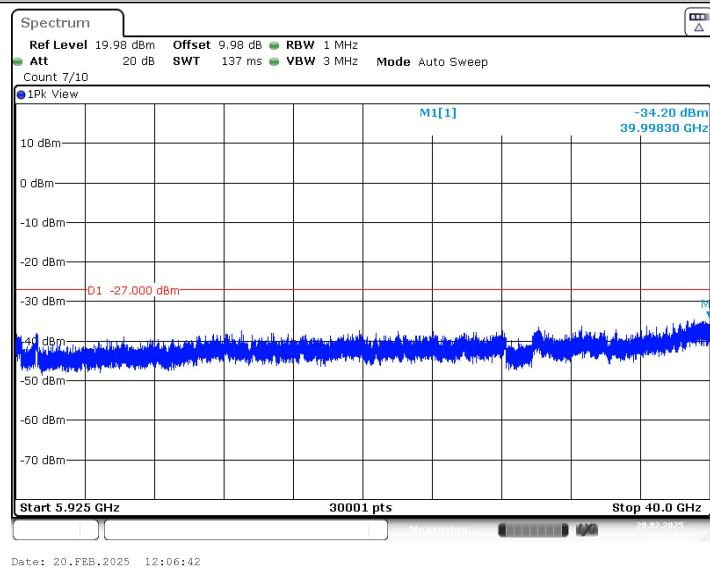

11AC80MIMO\_5210\_30~5140

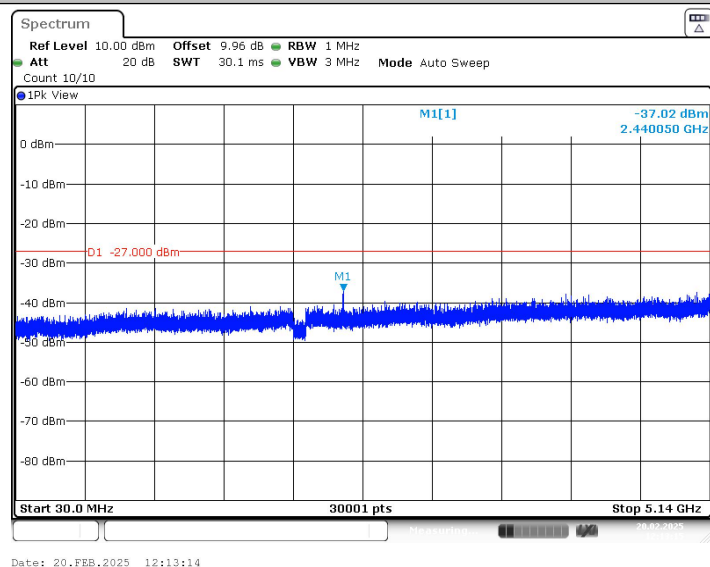


## 11AC80MIMO\_5210\_5360~40000

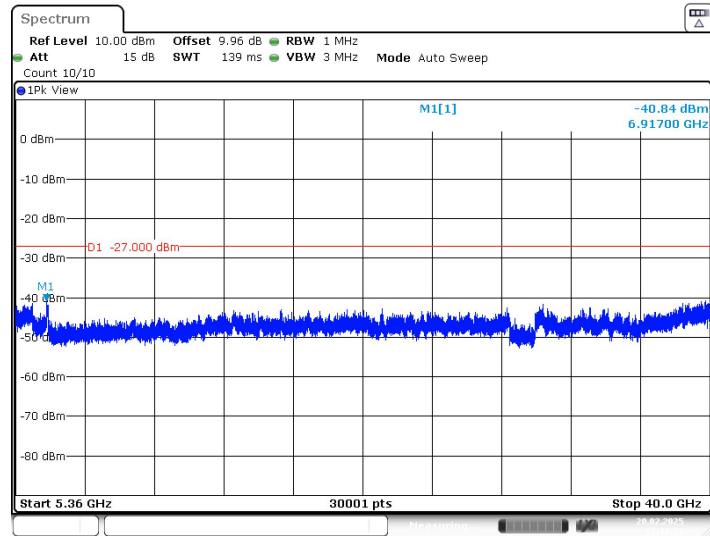

Date: 20.FEB.2025 12:13:23

## 11AC80MIMO\_5775\_30~5650

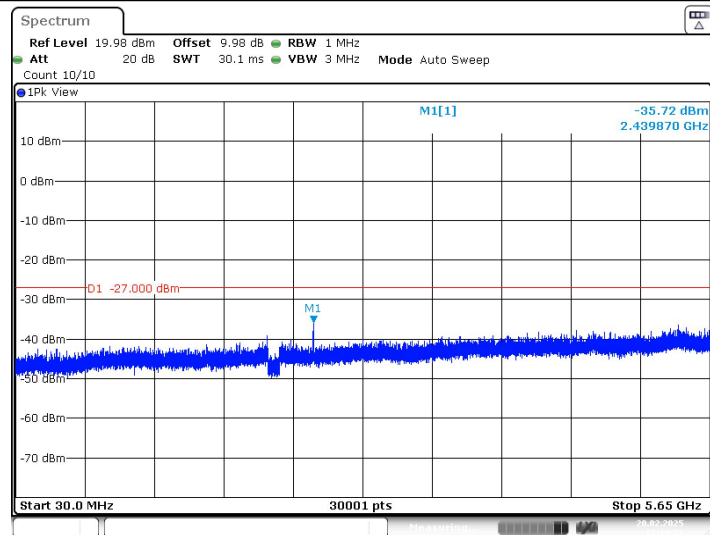

Date: 20.FEB.2025 12:19:53

## 11AC80MIMO\_5775\_5925~40000



## Appendix G: Frequency Stability

### Test Result

| Voltage  |         |            |               |                  |                |                 |             |         |
|----------|---------|------------|---------------|------------------|----------------|-----------------|-------------|---------|
| TestMode | Antenna | Freq(M Hz) | Voltage [Vdc] | Temperature (°C) | Deviation (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
| 11A      | Ant1    | 5180       | NV            | NT               | -20000.00      | -3.861004       | 20          | PASS    |
|          |         |            | LV            | NT               | -20000.00      | -3.861004       | 20          | PASS    |
|          |         |            | HV            | NT               | -20000.00      | -3.861004       | 20          | PASS    |
|          | Ant2    | 5180       | NV            | NT               | -20000.00      | -3.861004       | 20          | PASS    |
|          |         |            | LV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|          |         |            | HV            | NT               | -20000.00      | -3.861004       | 20          | PASS    |
|          | Ant1    | 5200       | NV            | NT               | -20000.00      | -3.846154       | 20          | PASS    |
|          |         |            | LV            | NT               | -20000.00      | -3.846154       | 20          | PASS    |
|          |         |            | HV            | NT               | -40000.00      | -7.692308       | 20          | PASS    |
|          | Ant2    | 5200       | NV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|          |         |            | LV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|          |         |            | HV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|          | Ant1    | 5240       | NV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|          |         |            | LV            | NT               | -20000.00      | -3.816794       | 20          | PASS    |
|          |         |            | HV            | NT               | -20000.00      | -3.816794       | 20          | PASS    |
|          | Ant2    | 5240       | NV            | NT               | -20000.00      | -3.816794       | 20          | PASS    |
|          |         |            | LV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|          |         |            | HV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|          | Ant1    | 5745       | NV            | NT               | -20000.00      | -3.481288       | 20          | PASS    |
|          |         |            | LV            | NT               | -20000.00      | -3.481288       | 20          | PASS    |
|          |         |            | HV            | NT               | -20000.00      | -3.481288       | 20          | PASS    |
|          | Ant2    | 5745       | NV            | NT               | -20000.00      | -3.481288       | 20          | PASS    |
|          |         |            | LV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|          |         |            | HV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|          | Ant1    | 5785       | NV            | NT               | -20000.00      | -3.457217       | 20          | PASS    |
|          |         |            | LV            | NT               | -40000.00      | -6.914434       | 20          | PASS    |
|          |         |            | HV            | NT               | -20000.00      | -3.457217       | 20          | PASS    |
|          | Ant2    | 5785       | NV            | NT               | -20000.00      | -3.457217       | 20          | PASS    |
|          |         |            | LV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|          |         |            | HV            | NT               | 20000.00       | 3.457217        | 20          | PASS    |
|          | Ant1    | 5825       | NV            | NT               | -40000.00      | -6.866953       | 20          | PASS    |
|          |         |            | LV            | NT               | -20000.00      | -3.433476       | 20          | PASS    |
|          |         |            | HV            | NT               | -20000.00      | -3.433476       | 20          | PASS    |
|          | Ant2    | 5825       | NV            | NT               | -20000.00      | -3.433476       | 20          | PASS    |
|          |         |            | LV            | NT               | -20000.00      | -3.433476       | 20          | PASS    |
|          |         |            | HV            | NT               | 0.00           | 0.000000        | 20          | PASS    |

|               |      |      |    |    |           |            |    |      |
|---------------|------|------|----|----|-----------|------------|----|------|
| 11N20MI<br>MO | Ant1 | 5180 | NV | NT | -20000.00 | -3.861004  | 20 | PASS |
|               |      |      | LV | NT | -20000.00 | -3.861004  | 20 | PASS |
|               |      |      | HV | NT | -20000.00 | -3.861004  | 20 | PASS |
|               | Ant2 | 5180 | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | LV | NT | -20000.00 | -3.861004  | 20 | PASS |
|               |      |      | HV | NT | -20000.00 | -3.861004  | 20 | PASS |
|               | Ant1 | 5200 | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | LV | NT | -60000.00 | -11.538462 | 20 | PASS |
|               |      |      | HV | NT | -20000.00 | -3.846154  | 20 | PASS |
|               | Ant2 | 5200 | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | LV | NT | 20000.00  | 3.846154   | 20 | PASS |
|               |      |      | HV | NT | -20000.00 | -3.846154  | 20 | PASS |
|               | Ant1 | 5240 | NV | NT | -40000.00 | -7.633588  | 20 | PASS |
|               |      |      | LV | NT | -20000.00 | -3.816794  | 20 | PASS |
|               |      |      | HV | NT | -20000.00 | -3.816794  | 20 | PASS |
|               | Ant2 | 5240 | NV | NT | -20000.00 | -3.816794  | 20 | PASS |
|               |      |      | LV | NT | -20000.00 | -3.816794  | 20 | PASS |
|               |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|               | Ant1 | 5745 | NV | NT | -40000.00 | -6.962576  | 20 | PASS |
|               |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | HV | NT | -20000.00 | -3.481288  | 20 | PASS |
|               | Ant2 | 5745 | NV | NT | -20000.00 | -3.481288  | 20 | PASS |
|               |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | HV | NT | -20000.00 | -3.481288  | 20 | PASS |
|               | Ant1 | 5785 | NV | NT | -20000.00 | -3.457217  | 20 | PASS |
|               |      |      | LV | NT | -20000.00 | -3.457217  | 20 | PASS |
|               |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|               | Ant2 | 5785 | NV | NT | 40000.00  | 6.914434   | 20 | PASS |
|               |      |      | LV | NT | -20000.00 | -3.457217  | 20 | PASS |
|               |      |      | HV | NT | 20000.00  | 3.457217   | 20 | PASS |
|               | Ant1 | 5825 | NV | NT | -60000.00 | -10.300429 | 20 | PASS |
|               |      |      | LV | NT | -20000.00 | -3.433476  | 20 | PASS |
|               |      |      | HV | NT | -60000.00 | -10.300429 | 20 | PASS |
|               | Ant2 | 5825 | NV | NT | -20000.00 | -3.433476  | 20 | PASS |
|               |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | HV | NT | -20000.00 | -3.433476  | 20 | PASS |
| 11N40MI<br>MO | Ant1 | 5190 | NV | NT | -40000.00 | -7.707129  | 20 | PASS |
|               |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|               | Ant2 | 5190 | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | LV | NT | -40000.00 | -7.707129  | 20 | PASS |
|               |      |      | HV | NT | -40000.00 | -7.707129  | 20 | PASS |
|               | Ant1 | 5230 | NV | NT | 0.00      | 0.000000   | 20 | PASS |

|                |      |      |    |    |           |           |    |      |
|----------------|------|------|----|----|-----------|-----------|----|------|
|                |      |      | LV | NT | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | HV | NT | 0.00      | 0.000000  | 20 | PASS |
|                | Ant2 | 5230 | NV | NT | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | HV | NT | -40000.00 | -7.648184 | 20 | PASS |
|                |      | 5755 | NV | NT | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | HV | NT | -40000.00 | -6.950478 | 20 | PASS |
|                |      | 5755 | NV | NT | 40000.00  | 6.950478  | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | HV | NT | 0.00      | 0.000000  | 20 | PASS |
|                | Ant1 | 5795 | NV | NT | 40000.00  | 6.902502  | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | HV | NT | 0.00      | 0.000000  | 20 | PASS |
|                | Ant2 | 5795 | NV | NT | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | HV | NT | 40000.00  | 6.902502  | 20 | PASS |
| 11AC20M<br>IMO | Ant1 | 5180 | NV | NT | -20000.00 | -3.861004 | 20 | PASS |
|                |      |      | LV | NT | -20000.00 | -3.861004 | 20 | PASS |
|                |      |      | HV | NT | 0.00      | 0.000000  | 20 | PASS |
|                | Ant2 | 5180 | NV | NT | -20000.00 | -3.861004 | 20 | PASS |
|                |      |      | LV | NT | -20000.00 | -3.861004 | 20 | PASS |
|                |      |      | HV | NT | -20000.00 | -3.861004 | 20 | PASS |
|                | Ant1 | 5200 | NV | NT | -20000.00 | -3.846154 | 20 | PASS |
|                |      |      | LV | NT | -20000.00 | -3.846154 | 20 | PASS |
|                |      |      | HV | NT | -40000.00 | -7.692308 | 20 | PASS |
|                | Ant2 | 5200 | NV | NT | -20000.00 | -3.846154 | 20 | PASS |
|                |      |      | LV | NT | -20000.00 | -3.846154 | 20 | PASS |
|                |      |      | HV | NT | 0.00      | 0.000000  | 20 | PASS |
|                | Ant1 | 5240 | NV | NT | -20000.00 | -3.816794 | 20 | PASS |
|                |      |      | LV | NT | -20000.00 | -3.816794 | 20 | PASS |
|                |      |      | HV | NT | 0.00      | 0.000000  | 20 | PASS |
|                | Ant2 | 5240 | NV | NT | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | LV | NT | -20000.00 | -3.816794 | 20 | PASS |
|                |      |      | HV | NT | -20000.00 | -3.816794 | 20 | PASS |
|                | Ant1 | 5745 | NV | NT | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | HV | NT | 0.00      | 0.000000  | 20 | PASS |
|                | Ant2 | 5745 | NV | NT | 20000.00  | 3.481288  | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | HV | NT | 20000.00  | 3.481288  | 20 | PASS |
|                | Ant1 | 5785 | NV | NT | -20000.00 | -3.457217 | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000  | 20 | PASS |

|                |      |      |    |    |           |            |    |      |
|----------------|------|------|----|----|-----------|------------|----|------|
|                |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|                | Ant2 | 5785 | NV | NT | -20000.00 | -3.457217  | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|                | Ant1 | 5825 | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | HV | NT | -20000.00 | -3.433476  | 20 | PASS |
|                | Ant2 | 5825 | NV | NT | -20000.00 | -3.433476  | 20 | PASS |
|                |      |      | LV | NT | 20000.00  | 3.433476   | 20 | PASS |
|                |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
| 11AC40M<br>IMO | Ant1 | 5190 | NV | NT | 40000.00  | 7.707129   | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | HV | NT | -40000.00 | -7.707129  | 20 | PASS |
|                | Ant2 | 5190 | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | HV | NT | 40000.00  | 7.707129   | 20 | PASS |
|                | Ant1 | 5230 | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | -40000.00 | -7.648184  | 20 | PASS |
|                |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|                | Ant2 | 5230 | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | HV | NT | -40000.00 | -7.648184  | 20 | PASS |
|                |      | 5755 | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | HV | NT | -40000.00 | -6.950478  | 20 | PASS |
|                | Ant2 | 5755 | NV | NT | -40000.00 | -6.950478  | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|                | Ant1 | 5795 | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | 40000.00  | 6.902502   | 20 | PASS |
|                |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|                | Ant2 | 5795 | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | -40000.00 | -6.902502  | 20 | PASS |
|                |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
| 11AC80M<br>IMO | Ant1 | 5210 | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | -80000.00 | -15.355086 | 20 | PASS |
|                |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|                | Ant2 | 5210 | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|                | Ant1 | 5290 | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |

|  |      |      |    |    |           |            |    |      |
|--|------|------|----|----|-----------|------------|----|------|
|  |      | 5775 | NV | NT | 80000.00  | 13.852814  | 20 | PASS |
|  |      |      | LV | NT | 80000.00  | 13.852814  | 20 | PASS |
|  |      |      | HV | NT | -80000.00 | -13.852814 | 20 | PASS |
|  | Ant2 | 5775 | NV | NT | 80000.00  | 13.852814  | 20 | PASS |
|  |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|  |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |

| Temperature |         |            |               |                  |                |                 |             |         |
|-------------|---------|------------|---------------|------------------|----------------|-----------------|-------------|---------|
| TestMode    | Antenna | Freq(M Hz) | Voltage [Vdc] | Temperature (°C) | Deviation (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
| 11A         | Ant1    | 5180       | NV            | -30              | -20000.00      | -3.861004       | 20          | PASS    |
|             |         |            | NV            | -20              | -20000.00      | -3.861004       | 20          | PASS    |
|             |         |            | NV            | -10              | -20000.00      | -3.861004       | 20          | PASS    |
|             |         |            | NV            | 0                | -40000.00      | -7.722008       | 20          | PASS    |
|             |         |            | NV            | 10               | -20000.00      | -3.861004       | 20          | PASS    |
|             |         |            | NV            | 20               | -40000.00      | -7.722008       | 20          | PASS    |
|             |         |            | NV            | 30               | -20000.00      | -3.861004       | 20          | PASS    |
|             |         |            | NV            | 40               | -20000.00      | -3.861004       | 20          | PASS    |
|             |         |            | NV            | 50               | 0.00           | 0.000000        | 20          | PASS    |
|             | Ant2    | 5180       | NV            | -30              | 0.00           | 0.000000        | 20          | PASS    |
|             |         |            | NV            | -20              | -20000.00      | -3.861004       | 20          | PASS    |
|             |         |            | NV            | -10              | 0.00           | 0.000000        | 20          | PASS    |
|             |         |            | NV            | 0                | 0.00           | 0.000000        | 20          | PASS    |
|             |         |            | NV            | 10               | 0.00           | 0.000000        | 20          | PASS    |
|             |         |            | NV            | 20               | 0.00           | 0.000000        | 20          | PASS    |
|             |         |            | NV            | 30               | -20000.00      | -3.861004       | 20          | PASS    |
|             |         |            | NV            | 40               | 20000.00       | 3.861004        | 20          | PASS    |
|             |         |            | NV            | 50               | -20000.00      | -3.861004       | 20          | PASS    |
|             | Ant1    | 5200       | NV            | -30              | -40000.00      | -7.692308       | 20          | PASS    |
|             |         |            | NV            | -20              | -20000.00      | -3.846154       | 20          | PASS    |
|             |         |            | NV            | -10              | -20000.00      | -3.846154       | 20          | PASS    |
|             |         |            | NV            | 0                | -40000.00      | -7.692308       | 20          | PASS    |
|             |         |            | NV            | 10               | -20000.00      | -3.846154       | 20          | PASS    |
|             |         |            | NV            | 20               | -20000.00      | -3.846154       | 20          | PASS    |
|             |         |            | NV            | 30               | -20000.00      | -3.846154       | 20          | PASS    |
|             |         |            | NV            | 40               | -20000.00      | -3.846154       | 20          | PASS    |
|             |         |            | NV            | 50               | -20000.00      | -3.846154       | 20          | PASS    |
|             | Ant2    | 5200       | NV            | -30              | -20000.00      | -3.846154       | 20          | PASS    |
|             |         |            | NV            | -20              | 0.00           | 0.000000        | 20          | PASS    |
|             |         |            | NV            | -10              | 0.00           | 0.000000        | 20          | PASS    |
|             |         |            | NV            | 0                | 0.00           | 0.000000        | 20          | PASS    |
|             |         |            | NV            | 10               | 0.00           | 0.000000        | 20          | PASS    |
|             |         |            | NV            | 20               | 0.00           | 0.000000        | 20          | PASS    |

|  |      |      |    |     |           |           |    |      |
|--|------|------|----|-----|-----------|-----------|----|------|
|  |      |      | NV | 30  | 0.00      | 0.000000  | 20 | PASS |
|  |      |      | NV | 40  | -40000.00 | -7.692308 | 20 | PASS |
|  |      |      | NV | 50  | -20000.00 | -3.846154 | 20 | PASS |
|  | Ant1 | 5240 | NV | -30 | -40000.00 | -7.633588 | 20 | PASS |
|  |      |      | NV | -20 | -40000.00 | -7.633588 | 20 | PASS |
|  |      |      | NV | -10 | -40000.00 | -7.633588 | 20 | PASS |
|  |      |      | NV | 0   | -20000.00 | -3.816794 | 20 | PASS |
|  |      |      | NV | 10  | -20000.00 | -3.816794 | 20 | PASS |
|  |      |      | NV | 20  | -20000.00 | -3.816794 | 20 | PASS |
|  |      |      | NV | 30  | -20000.00 | -3.816794 | 20 | PASS |
|  |      |      | NV | 40  | -20000.00 | -3.816794 | 20 | PASS |
|  |      |      | NV | 50  | 0.00      | 0.000000  | 20 | PASS |
|  | Ant2 | 5240 | NV | -30 | 0.00      | 0.000000  | 20 | PASS |
|  |      |      | NV | -20 | 0.00      | 0.000000  | 20 | PASS |
|  |      |      | NV | -10 | -20000.00 | -3.816794 | 20 | PASS |
|  |      |      | NV | 0   | -20000.00 | -3.816794 | 20 | PASS |
|  |      |      | NV | 10  | 0.00      | 0.000000  | 20 | PASS |
|  |      |      | NV | 20  | 0.00      | 0.000000  | 20 | PASS |
|  |      |      | NV | 30  | -20000.00 | -3.816794 | 20 | PASS |
|  |      |      | NV | 40  | 20000.00  | 3.816794  | 20 | PASS |
|  |      |      | NV | 50  | -20000.00 | -3.816794 | 20 | PASS |
|  | Ant1 | 5745 | NV | -30 | -40000.00 | -6.962576 | 20 | PASS |
|  |      |      | NV | -20 | 0.00      | 0.000000  | 20 | PASS |
|  |      |      | NV | -10 | -20000.00 | -3.481288 | 20 | PASS |
|  |      |      | NV | 0   | -20000.00 | -3.481288 | 20 | PASS |
|  |      |      | NV | 10  | -20000.00 | -3.481288 | 20 | PASS |
|  |      |      | NV | 20  | -40000.00 | -6.962576 | 20 | PASS |
|  |      |      | NV | 30  | 0.00      | 0.000000  | 20 | PASS |
|  |      |      | NV | 40  | -20000.00 | -3.481288 | 20 | PASS |
|  |      |      | NV | 50  | -20000.00 | -3.481288 | 20 | PASS |
|  | Ant2 | 5745 | NV | -30 | -40000.00 | -6.962576 | 20 | PASS |
|  |      |      | NV | -20 | -20000.00 | -3.481288 | 20 | PASS |
|  |      |      | NV | -10 | 0.00      | 0.000000  | 20 | PASS |
|  |      |      | NV | 0   | -20000.00 | -3.481288 | 20 | PASS |
|  |      |      | NV | 10  | 20000.00  | 3.481288  | 20 | PASS |
|  |      |      | NV | 20  | 0.00      | 0.000000  | 20 | PASS |
|  |      |      | NV | 30  | -20000.00 | -3.481288 | 20 | PASS |
|  |      |      | NV | 40  | -20000.00 | -3.481288 | 20 | PASS |
|  |      |      | NV | 50  | 0.00      | 0.000000  | 20 | PASS |
|  | Ant1 | 5785 | NV | -30 | -20000.00 | -3.457217 | 20 | PASS |
|  |      |      | NV | -20 | -20000.00 | -3.457217 | 20 | PASS |
|  |      |      | NV | -10 | -40000.00 | -6.914434 | 20 | PASS |
|  |      |      | NV | 0   | -40000.00 | -6.914434 | 20 | PASS |