



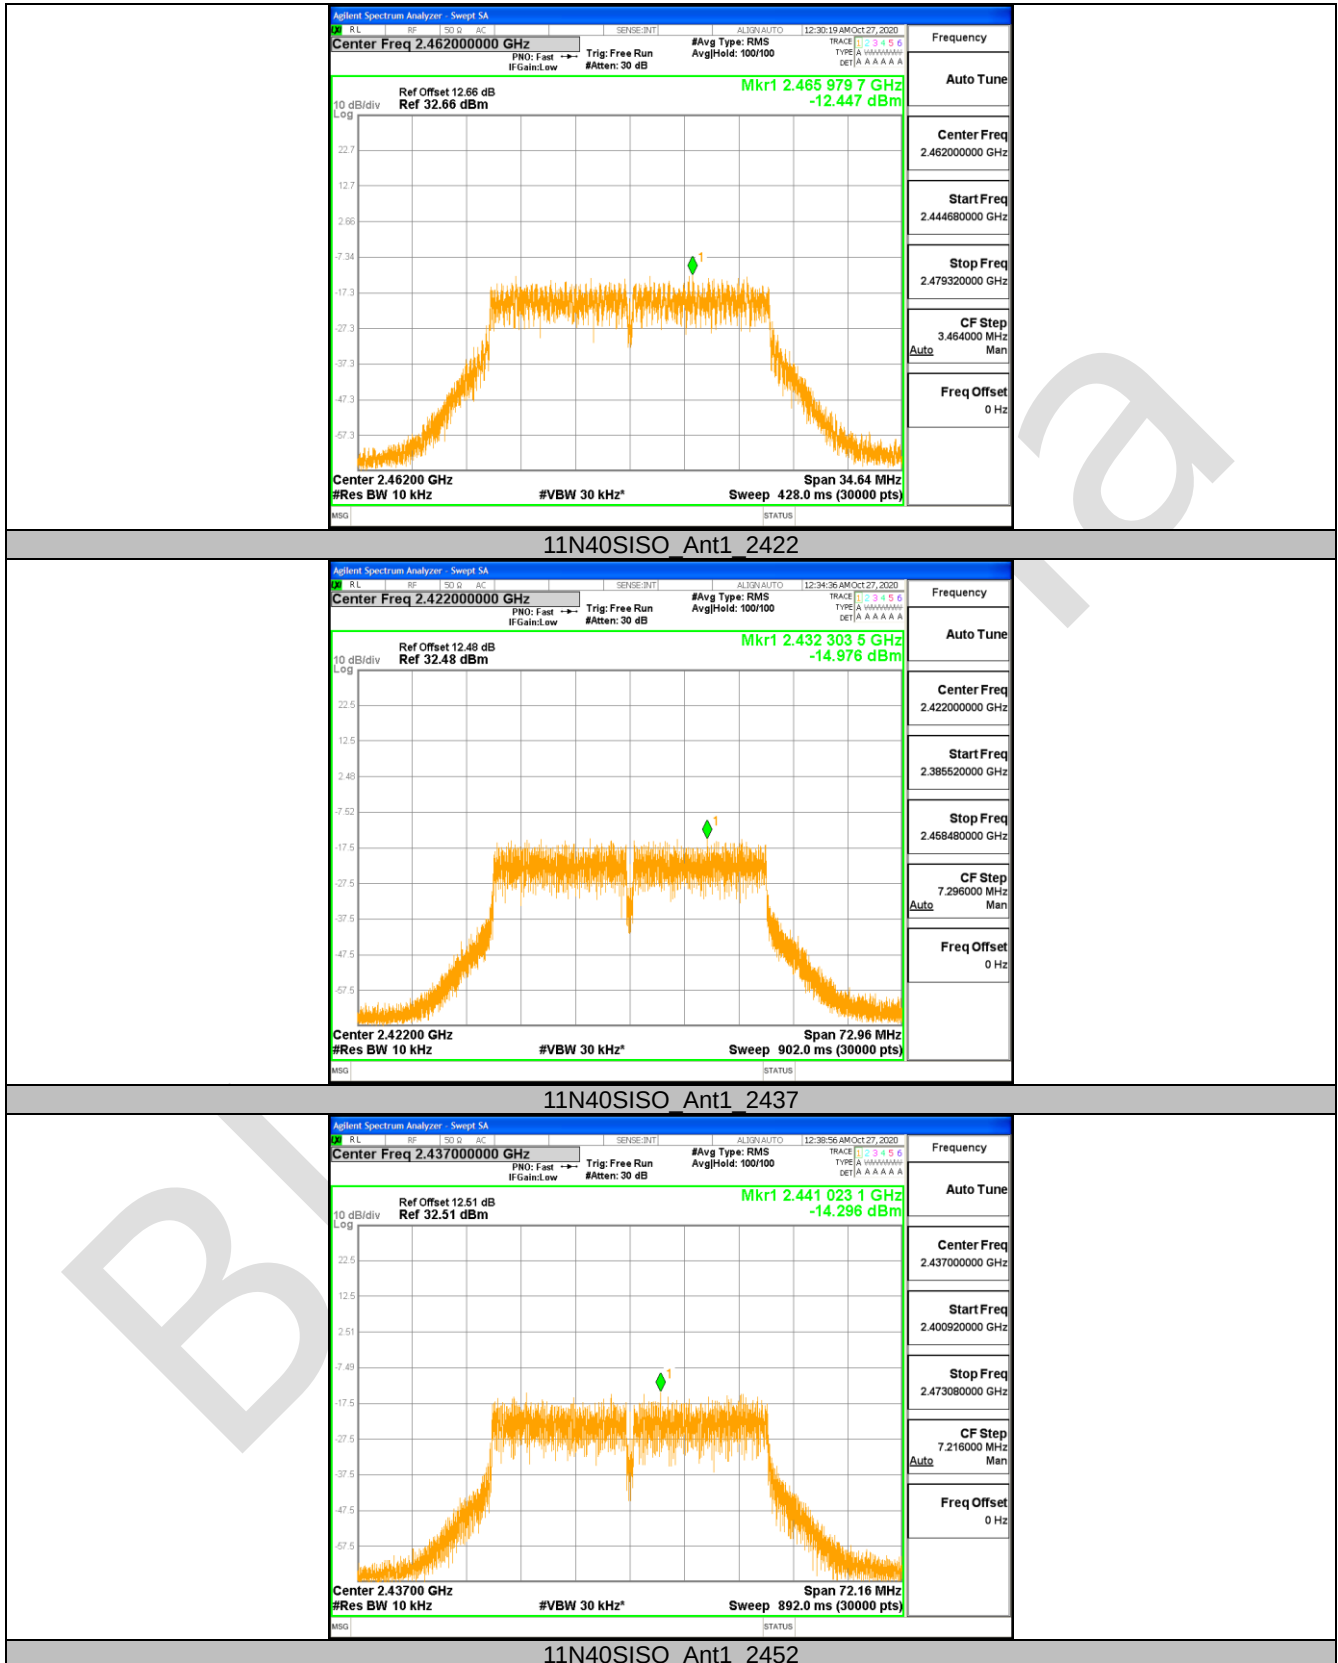

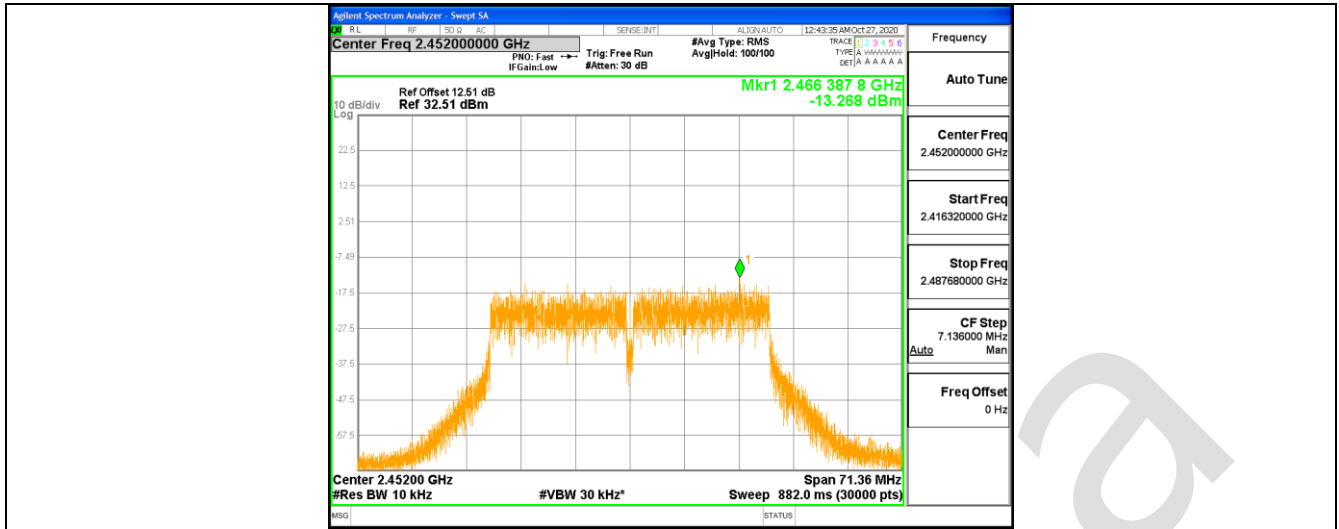


10.5 APPENDIX E: BAND EDGE MEASUREMENTS

Test Result


TestMode	Antenna	ChName	Channel	RefLevel[dBm]	Result[dBm]	Limit[dBm]	Verdict
11B	Ant1	Low	2412	5.86	-52.26	<=-24.14	PASS
		High	2462	4.73	-51.5	<=-25.27	PASS
11G	Ant1	Low	2412	2.22	-48.26	<=-27.78	PASS
		High	2462	1.36	-51.53	<=-28.64	PASS
11N20SISO	Ant1	Low	2412	2.79	-47.04	<=-27.21	PASS
		High	2462	1.49	-51.22	<=-28.51	PASS
11N40SISO	Ant1	Low	2422	-0.97	-43.9	<=-30.97	PASS
		High	2452	-0.62	-50.02	<=-30.62	PASS

Test Graphs




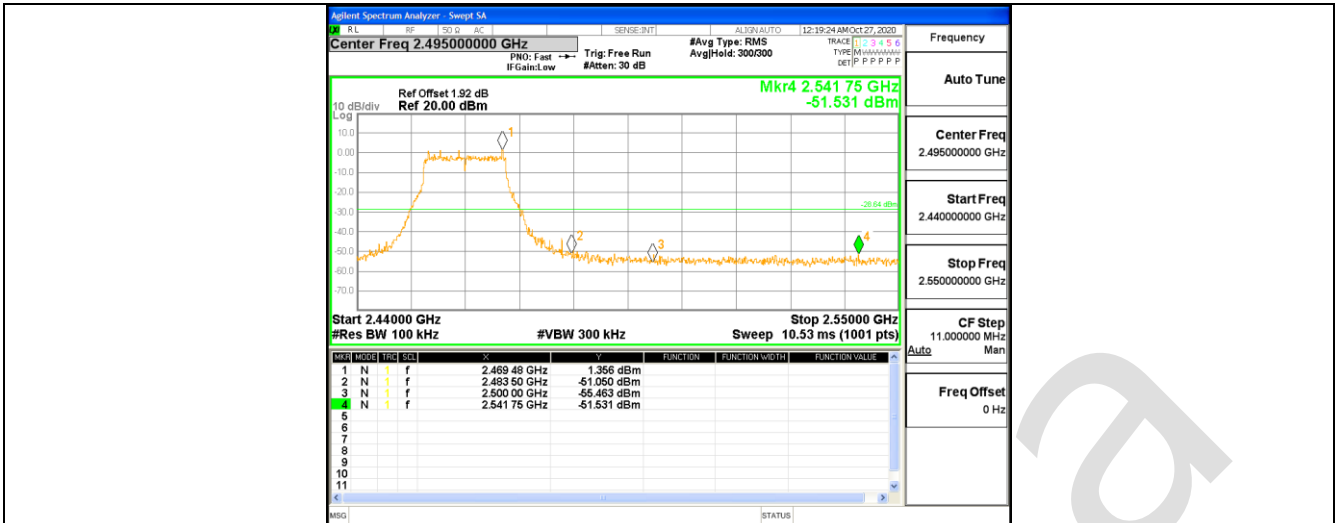


11N20SISO Ant1 Low 2412

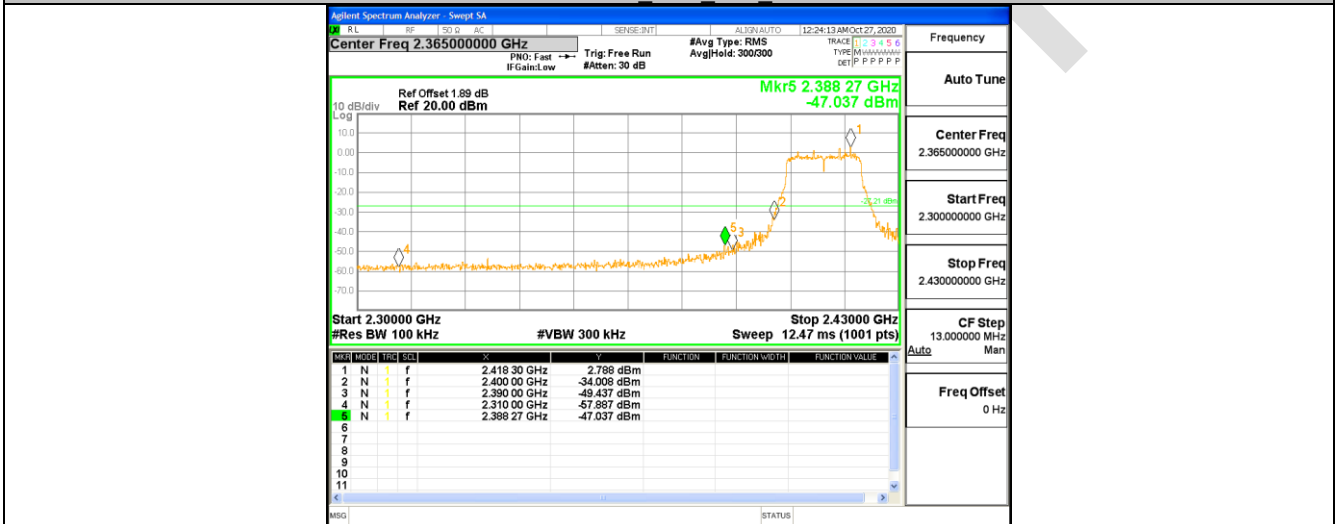

11N20SISO Ant1 High 2462

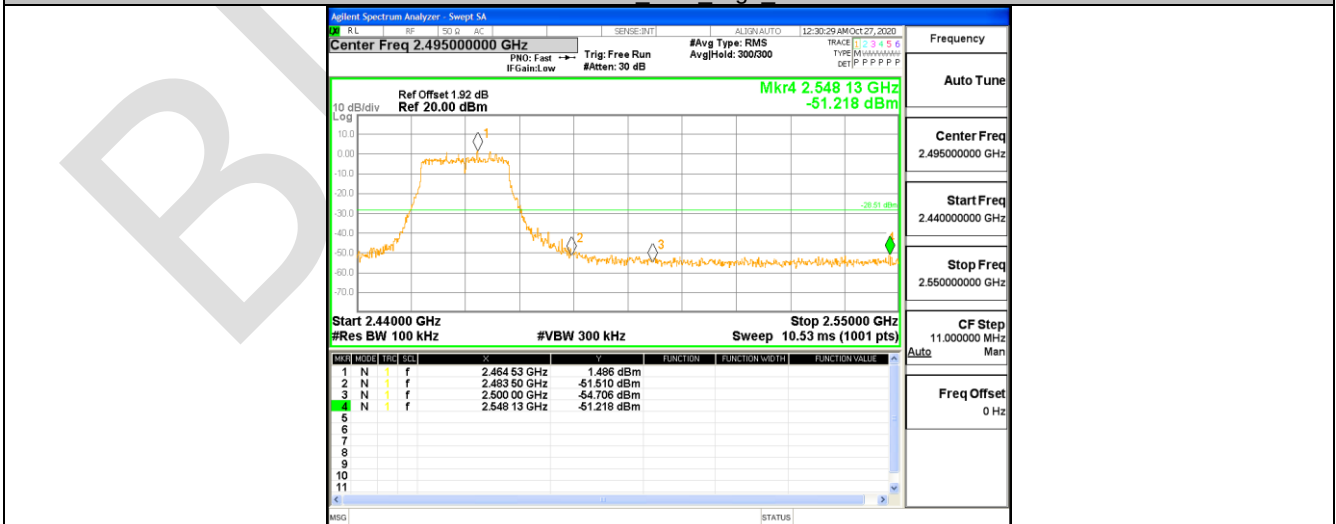

11N40SISO Ant1 Low 2422

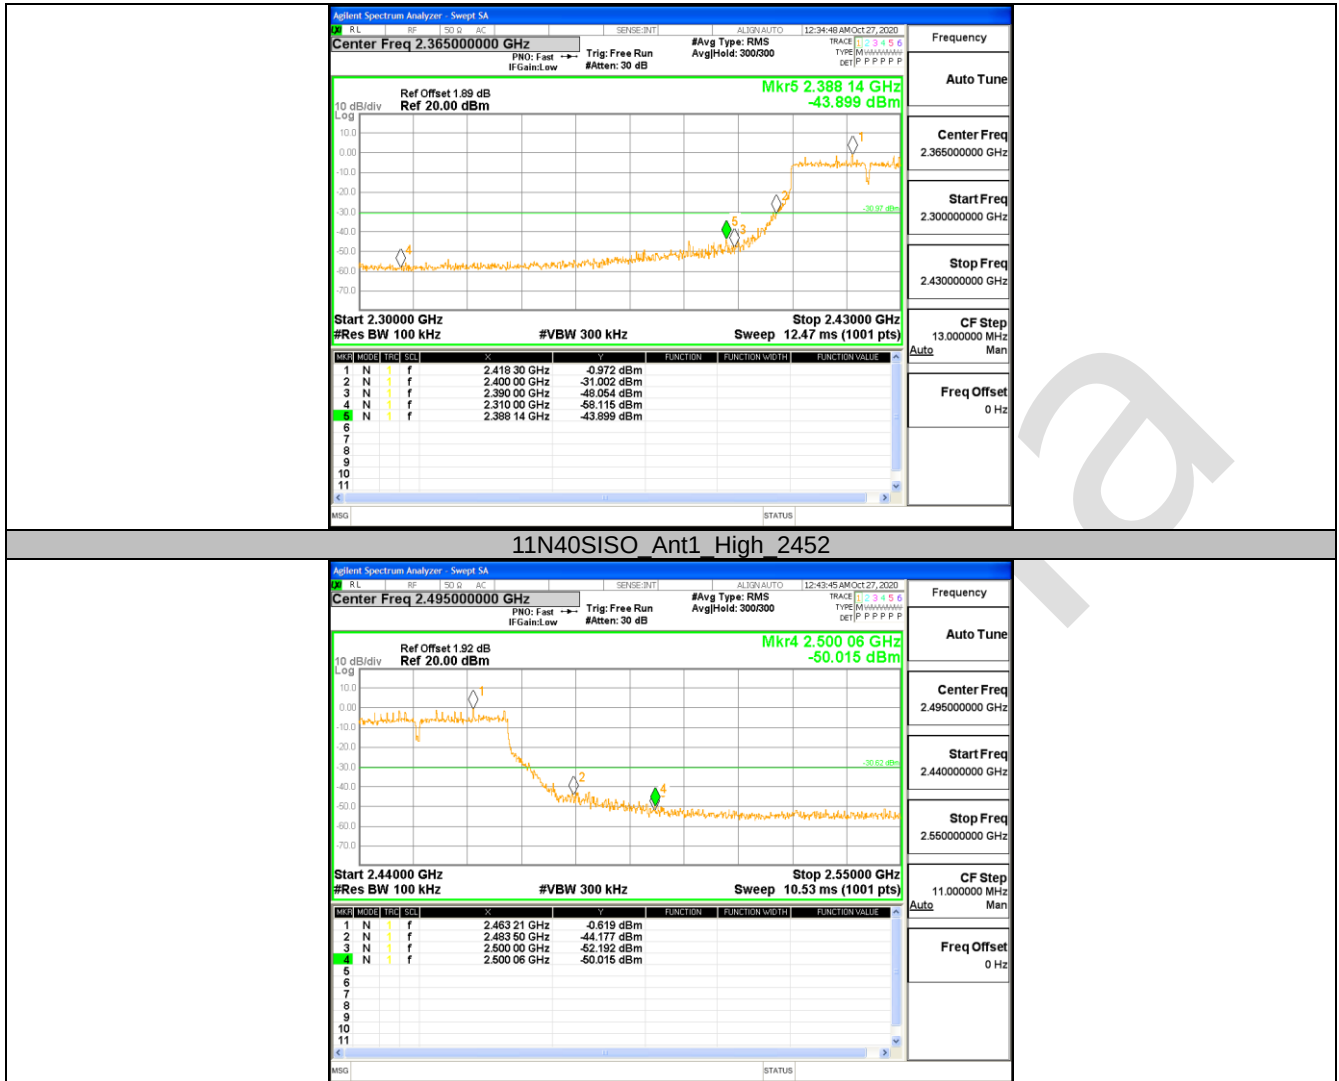

10.6 APPENDIX F: CONDUCTED SPURIOUS EMISSION

Test Result

TestMode	Antenna	Channel	FreqRange [Mhz]	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
11B	Ant1	2412	Reference	6.00	6.00	---	PASS
			30~1000	30~1000	-50.673	<=-24	PASS
			1000~26500	1000~26500	-30.145	<=-24	PASS
		2437	Reference	3.60	3.60	---	PASS
			30~1000	30~1000	-52.5	<=-26.399	PASS
			1000~26500	1000~26500	-31.807	<=-26.399	PASS
		2462	Reference	5.67	5.67	---	PASS
			30~1000	30~1000	-51.136	<=-24.332	PASS
			1000~26500	1000~26500	-33.645	<=-24.332	PASS
11G	Ant1	2412	Reference	1.24	1.24	---	PASS
			30~1000	30~1000	-54.573	<=-28.757	PASS
			1000~26500	1000~26500	-33.104	<=-28.757	PASS
		2437	Reference	1.48	1.48	---	PASS
			30~1000	30~1000	-53.444	<=-28.524	PASS
			1000~26500	1000~26500	-33.961	<=-28.524	PASS
		2462	Reference	0.53	0.53	---	PASS
			30~1000	30~1000	-54.392	<=-29.468	PASS
			1000~26500	1000~26500	-34.002	<=-29.468	PASS
11N20SISO	Ant1	2412	Reference	2.47	2.47	---	PASS
			30~1000	30~1000	-51.237	<=-27.528	PASS
			1000~26500	1000~26500	-33.047	<=-27.528	PASS
		2437	Reference	1.22	1.22	---	PASS
			30~1000	30~1000	-55.192	<=-28.779	PASS
			1000~26500	1000~26500	-34.069	<=-28.779	PASS
		2462	Reference	1.75	1.75	---	PASS
			30~1000	30~1000	-54.17	<=-28.248	PASS
			1000~26500	1000~26500	-34.082	<=-28.248	PASS
11N40SISO	Ant1	2422	Reference	-1.35	-1.35	---	PASS
			30~1000	30~1000	-56.792	<=-31.352	PASS
			1000~26500	1000~26500	-33.601	<=-31.352	PASS
		2437	Reference	-2.51	-2.51	---	PASS
			30~1000	30~1000	-57.863	<=-32.511	PASS
			1000~26500	1000~26500	-34.37	<=-32.511	PASS
		2452	Reference	-2.24	-2.24	---	PASS
			30~1000	30~1000	-55.302	<=-32.244	PASS
			1000~26500	1000~26500	-34.042	<=-32.244	PASS

Test Graphs



