



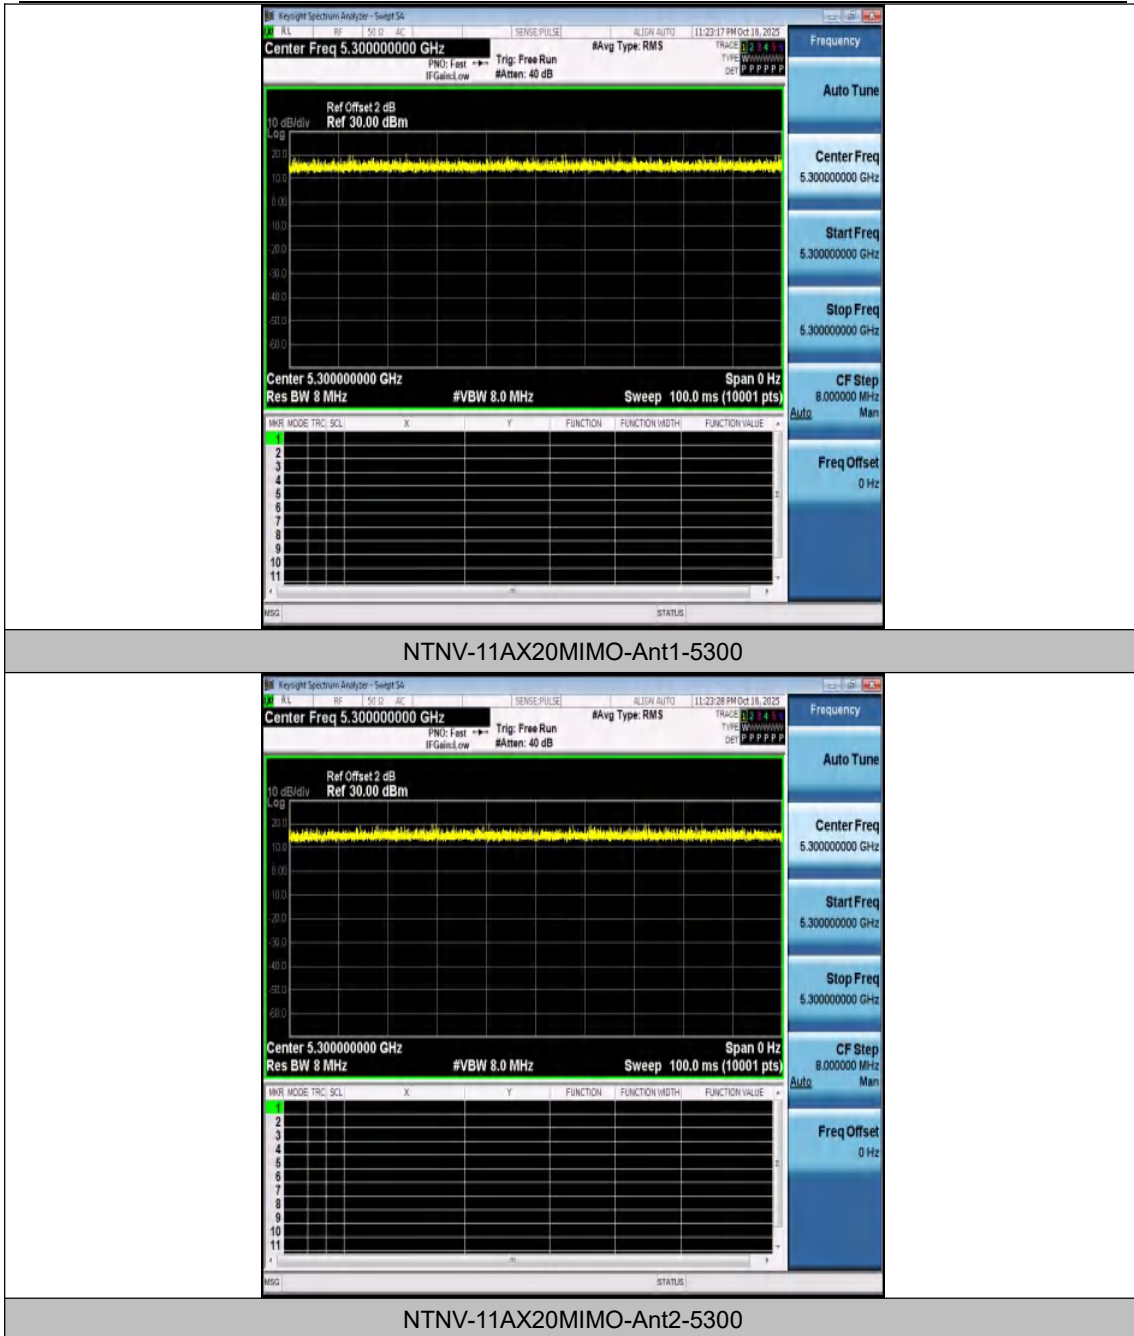

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

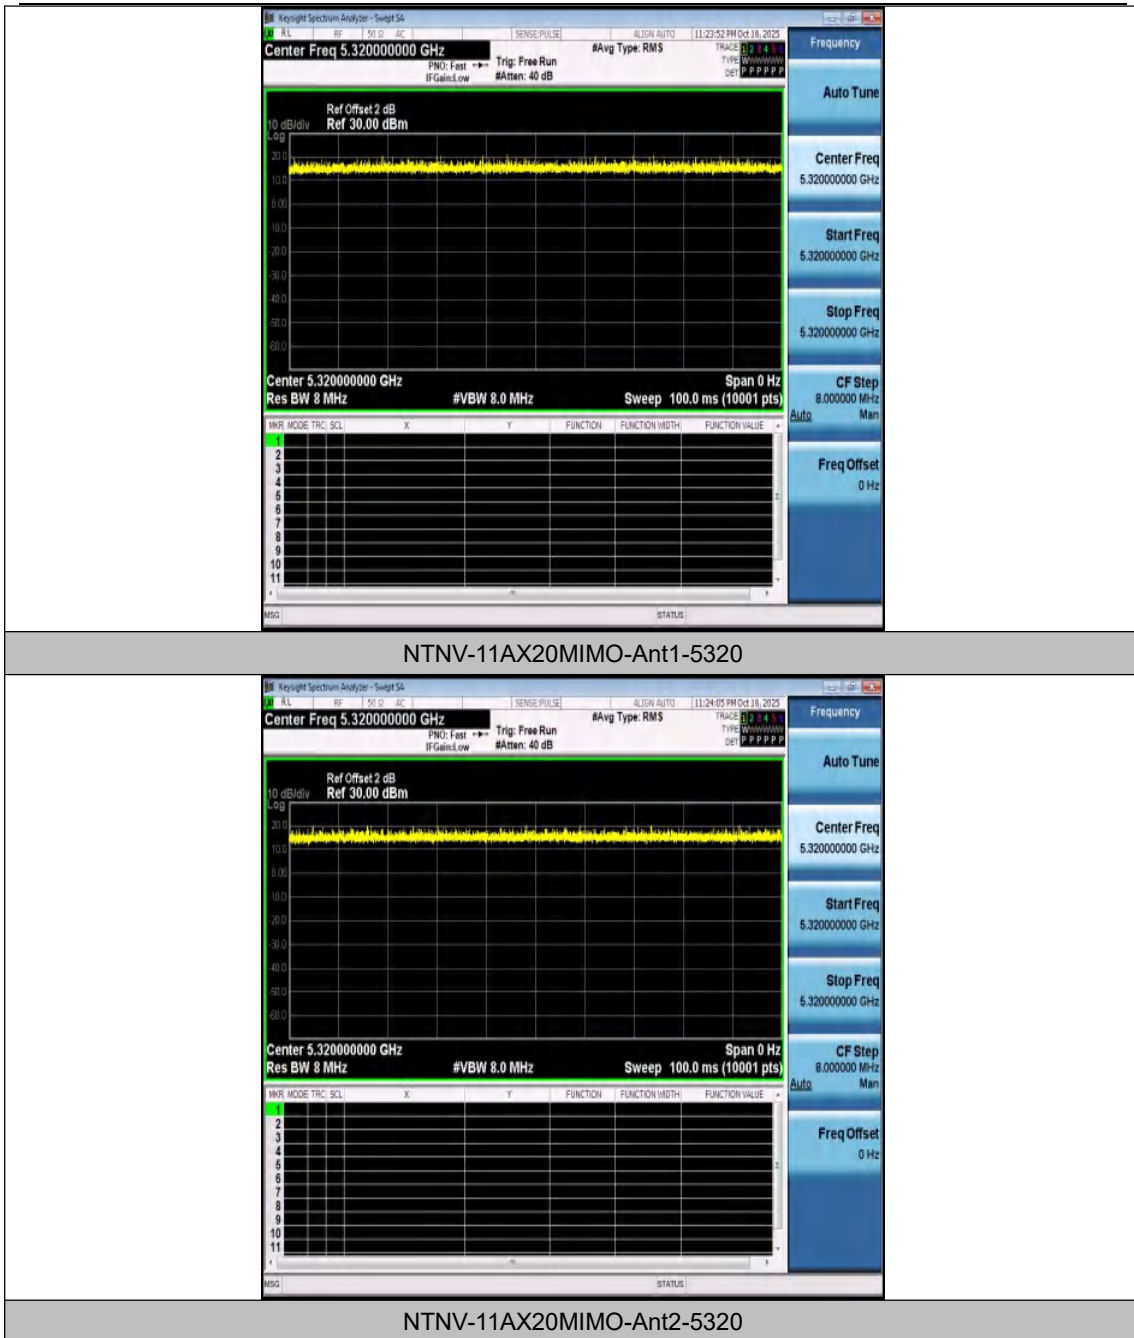

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

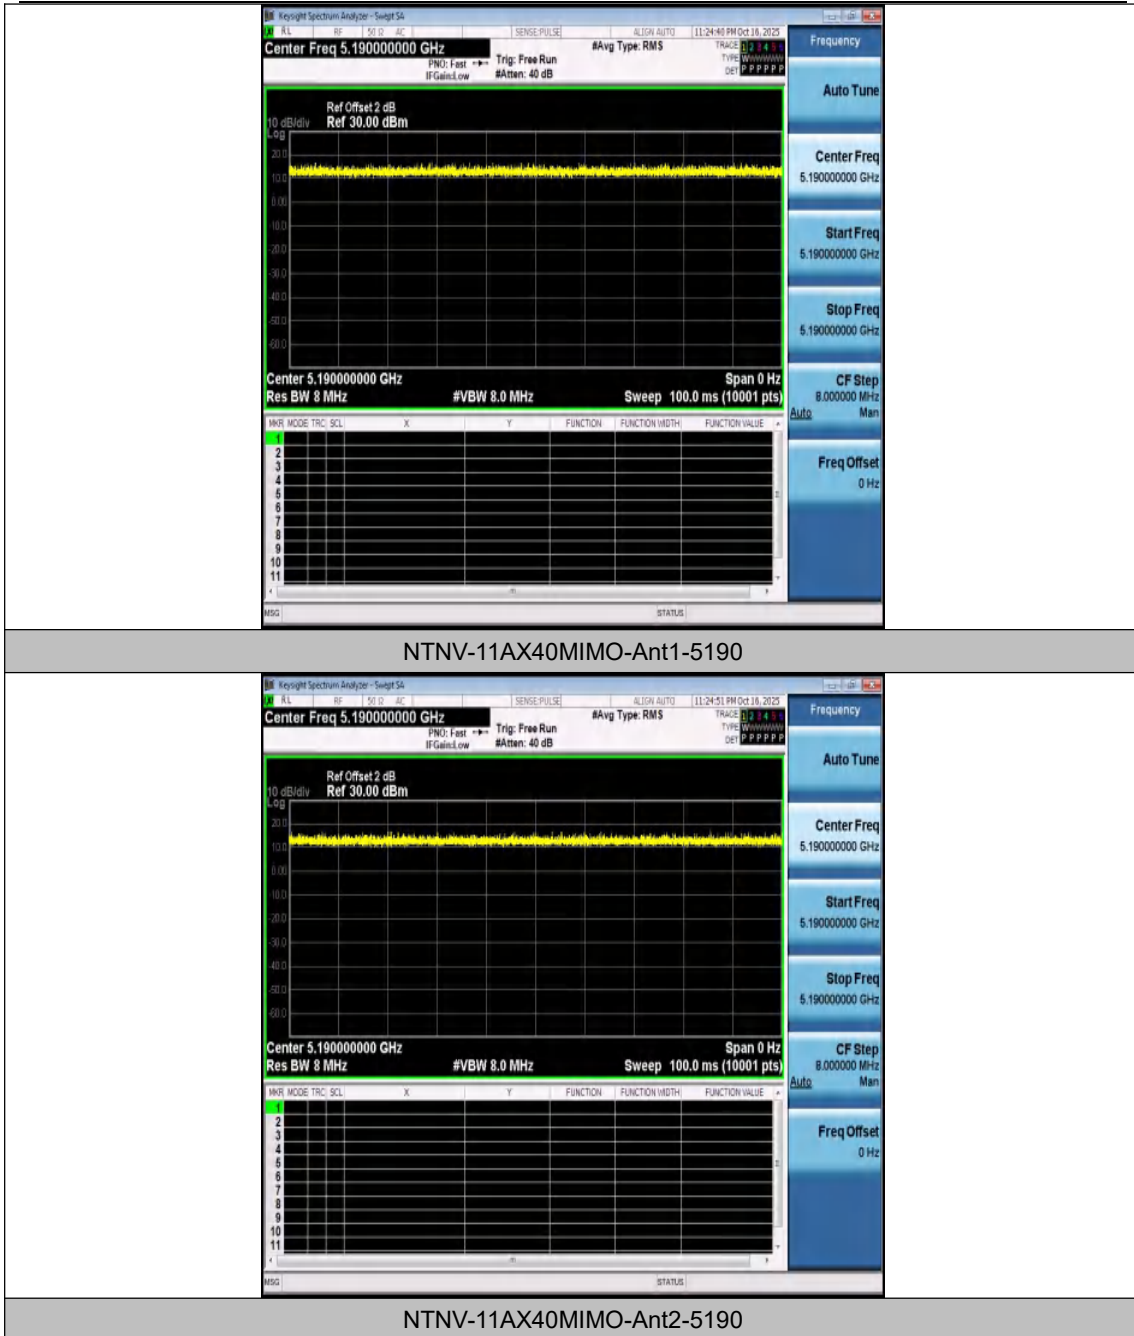

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

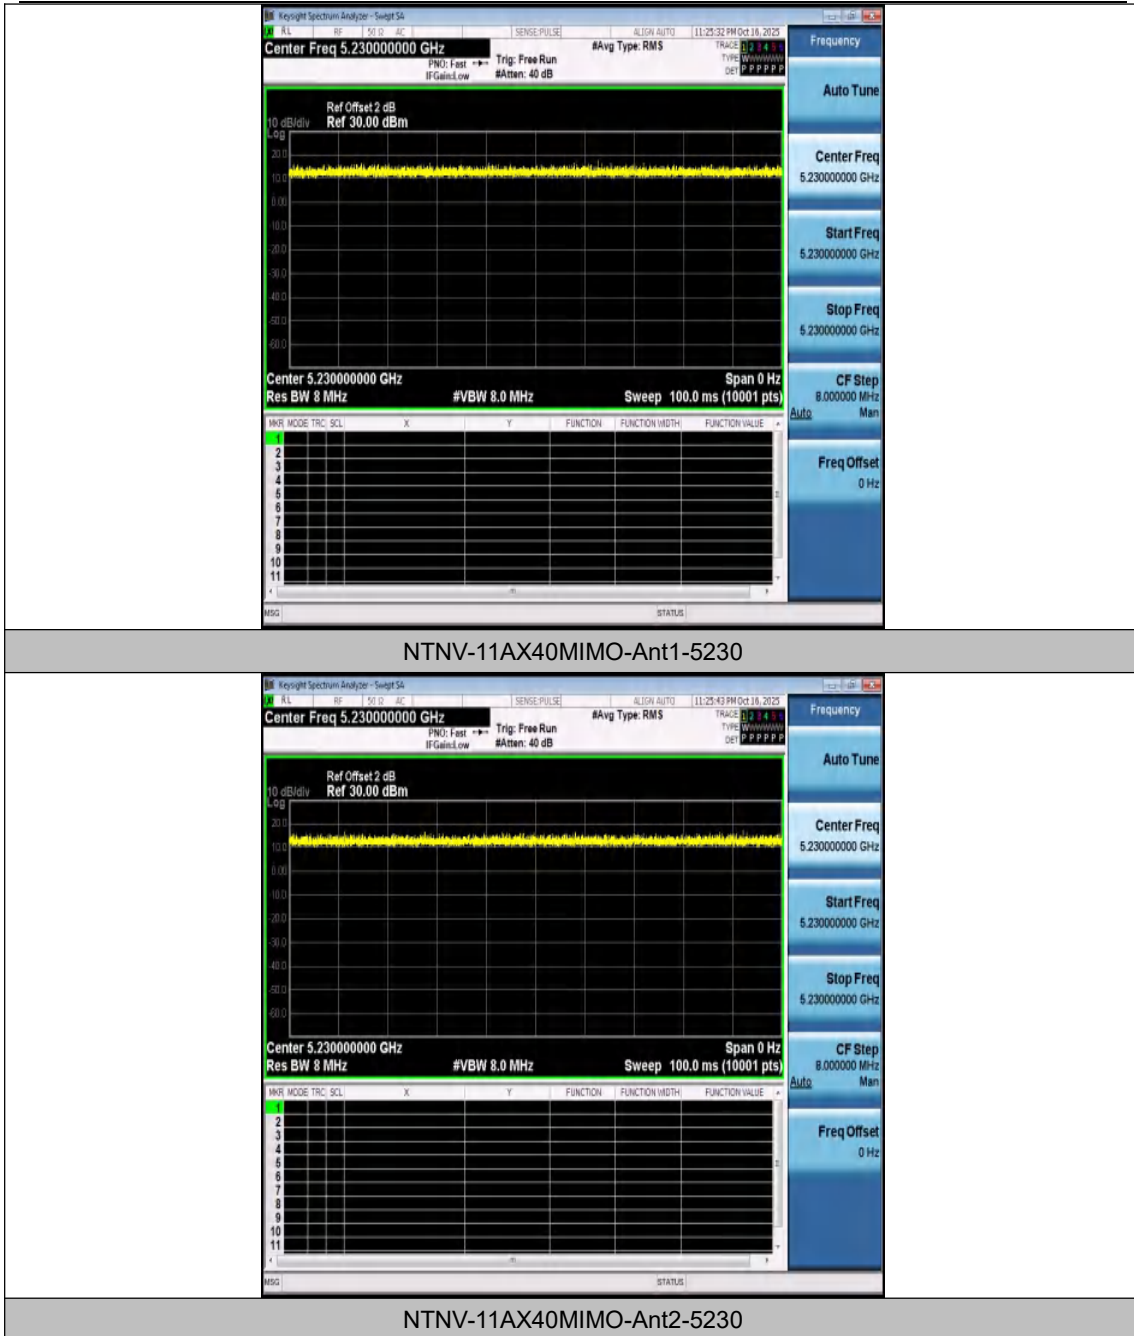



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

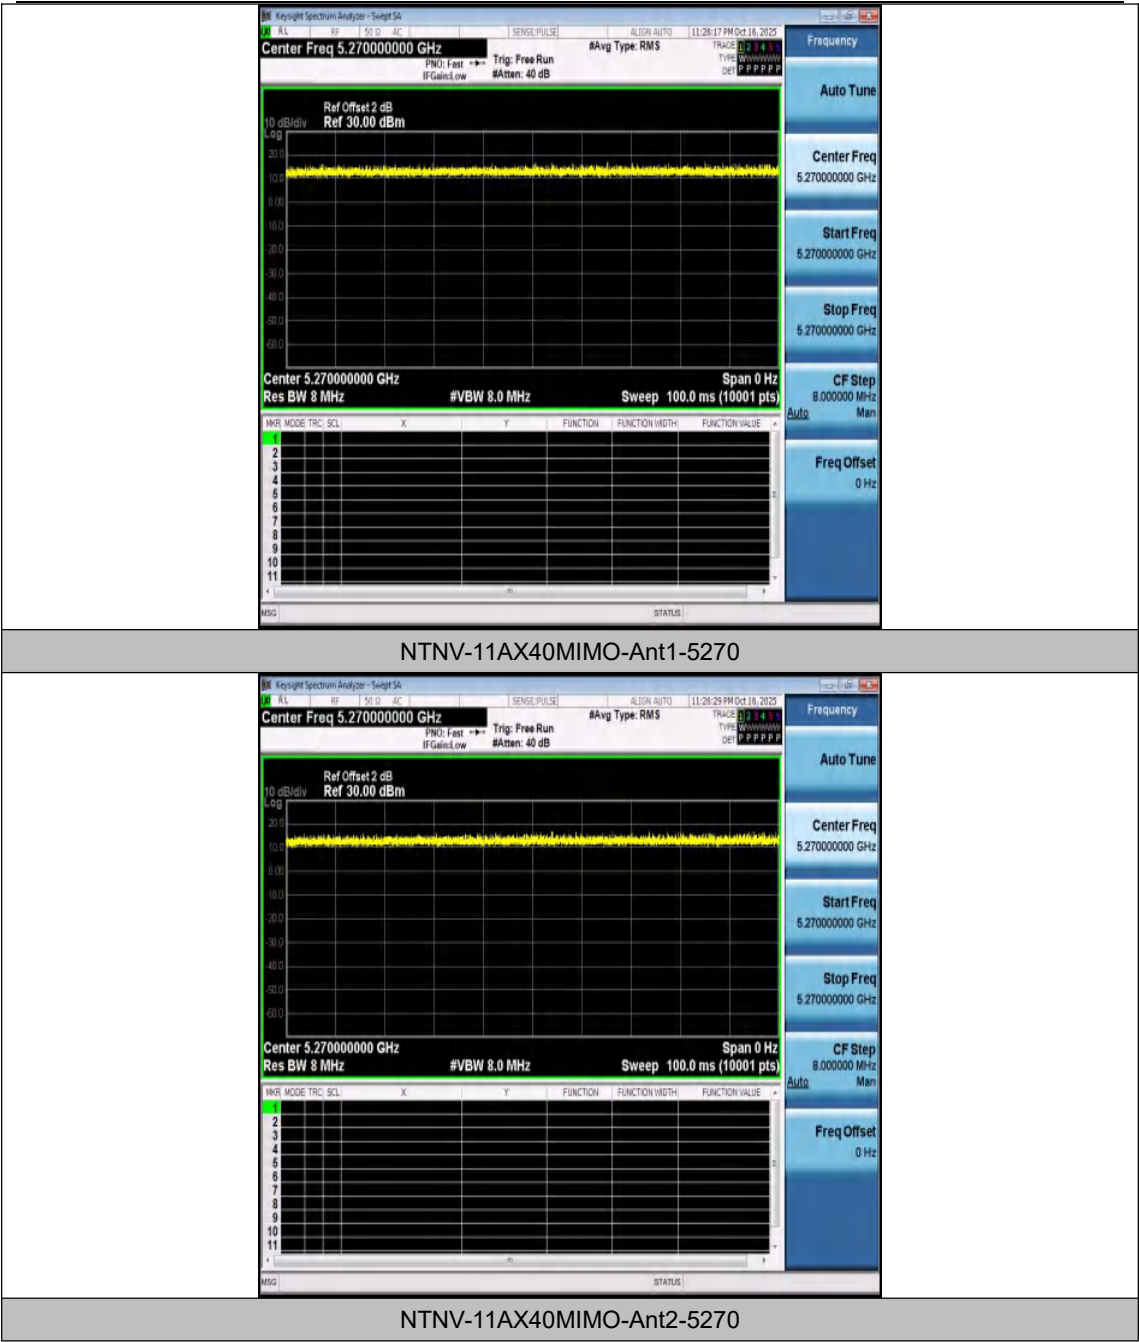


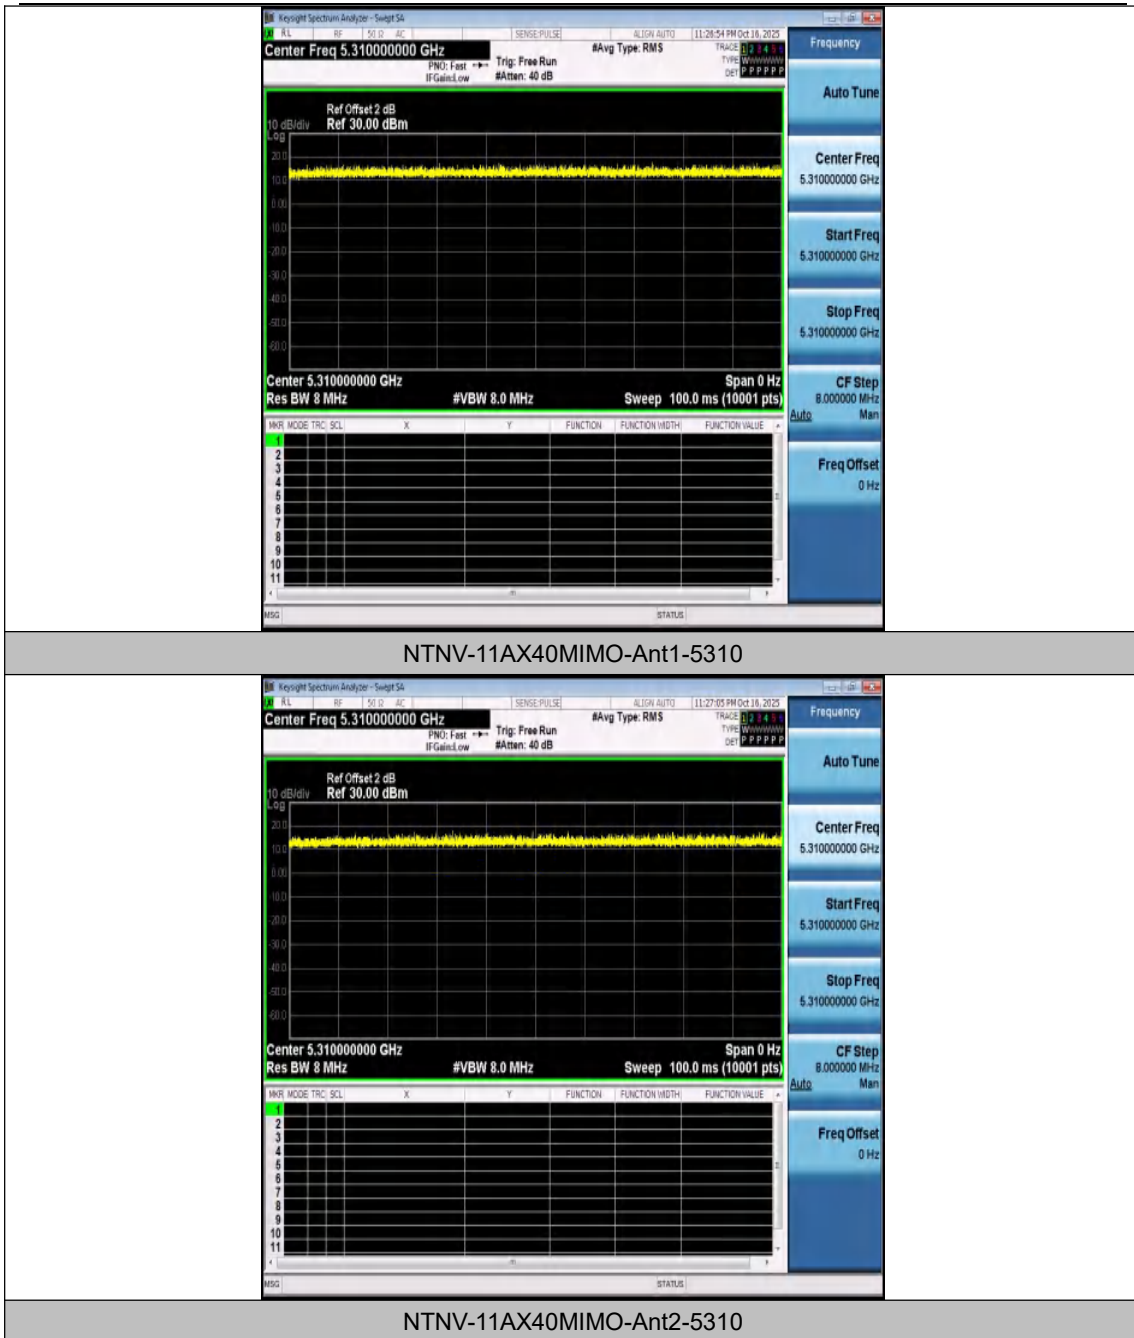

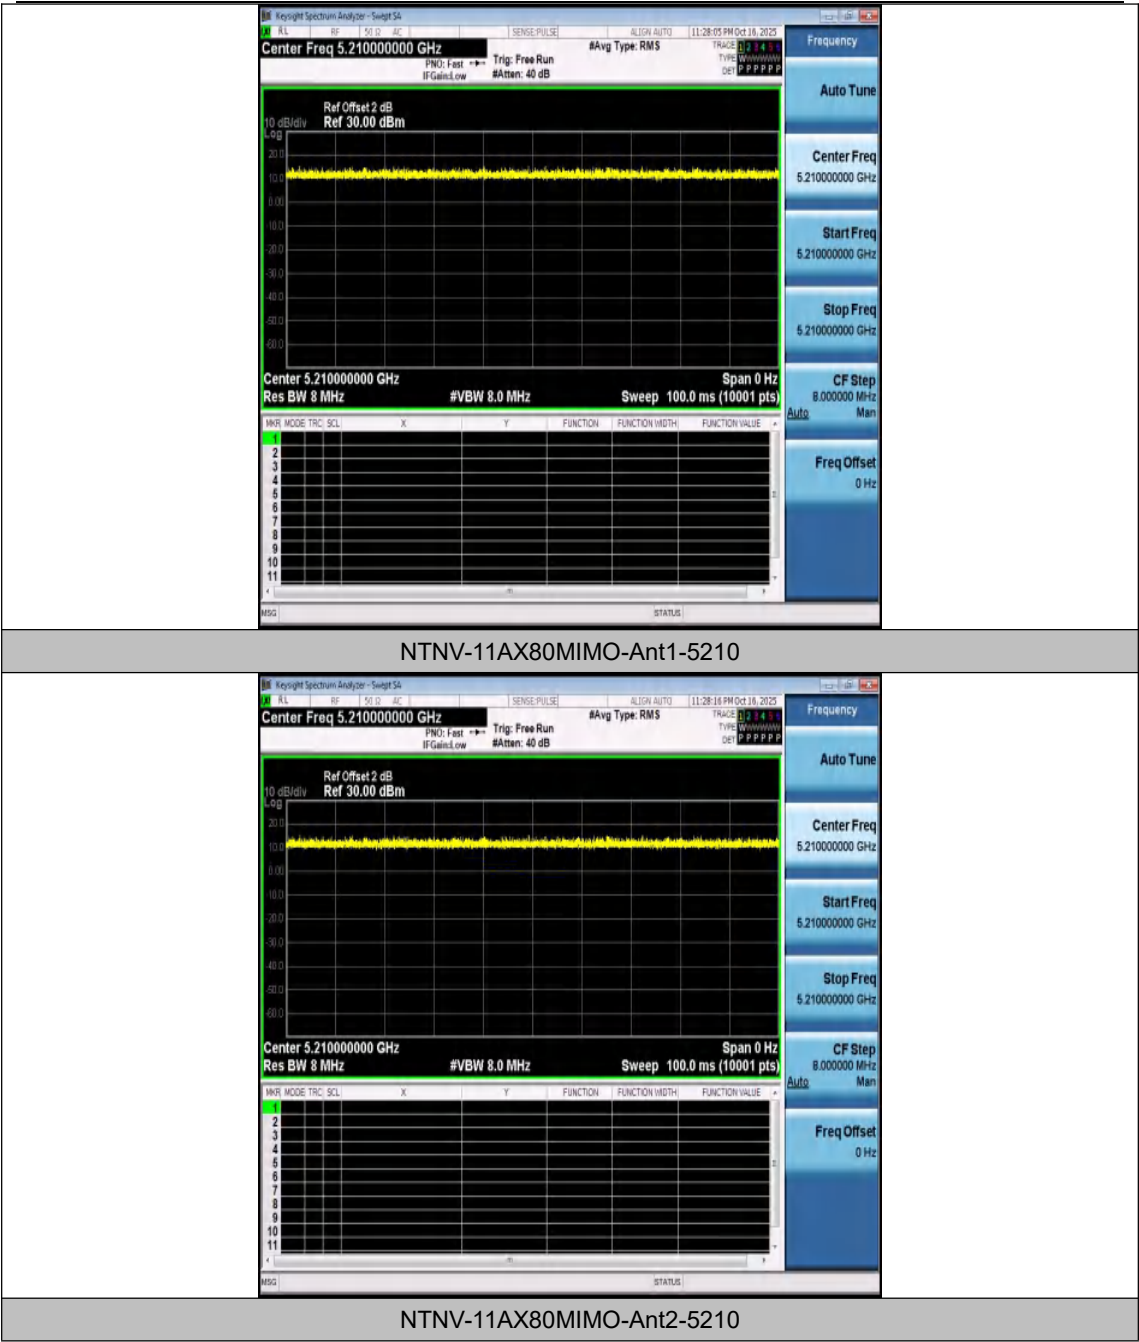

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

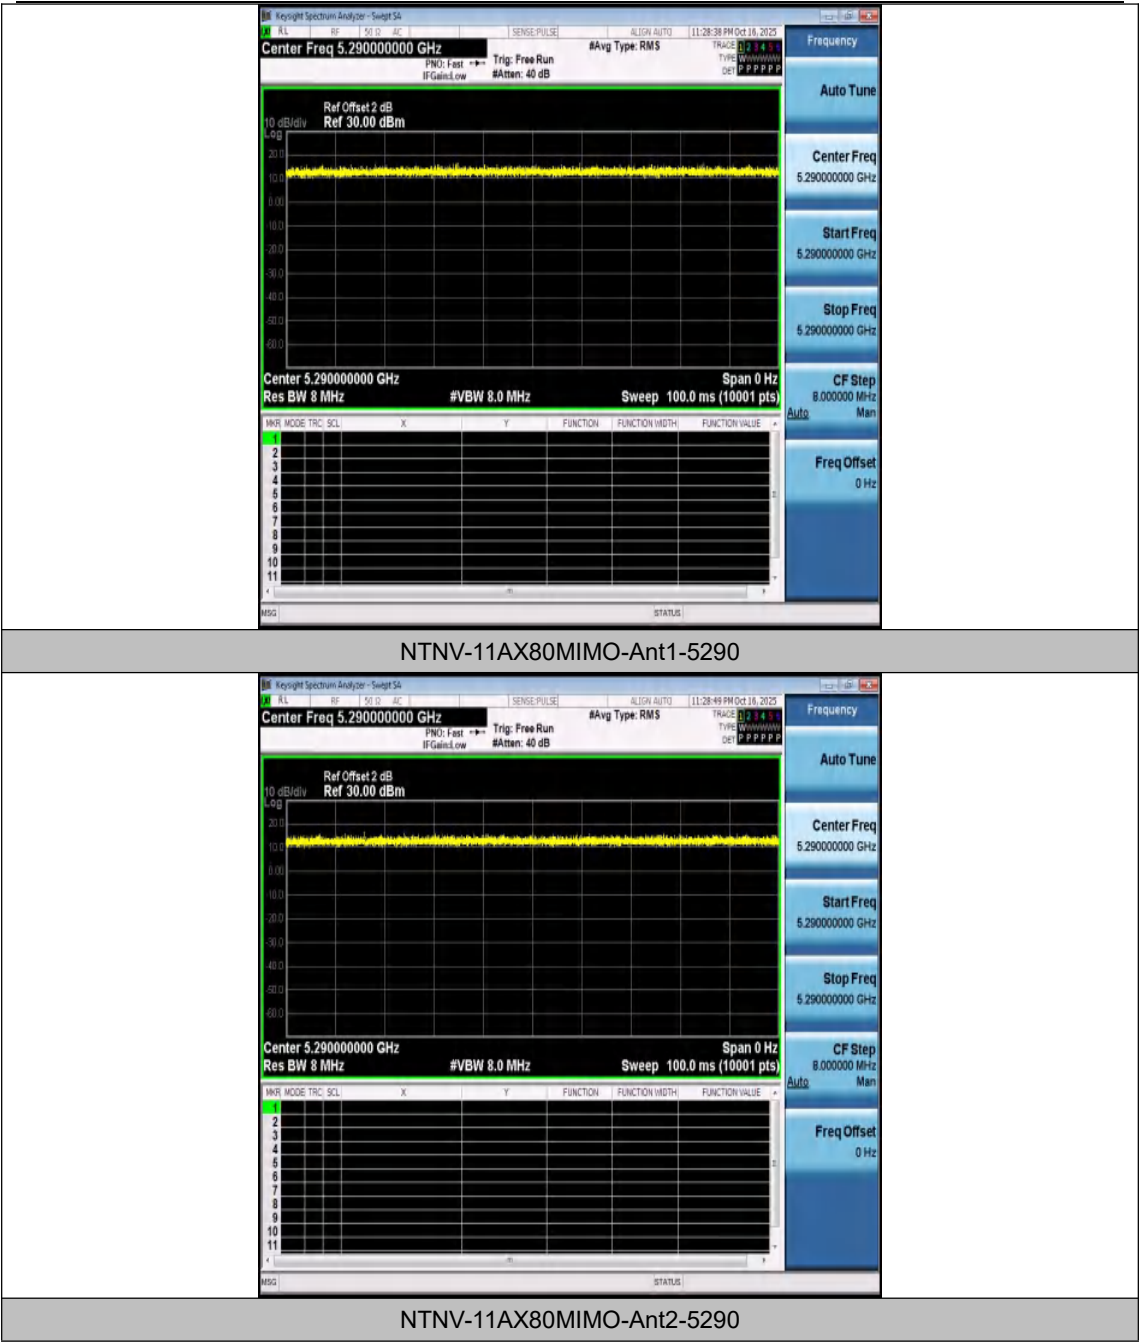

Appendix C: Maximum Conducted Output Power

Test Result Channel Power


Test Mode	Antenna	Frequency[MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	14.18	≤23.98	PASS
11A	Ant2	5180	14.20	≤23.98	PASS
11A	Ant1	5220	13.79	≤23.98	PASS
11A	Ant2	5220	13.79	≤23.98	PASS
11A	Ant1	5240	13.15	≤23.98	PASS
11A	Ant2	5240	13.19	≤23.98	PASS
11A	Ant1	5260	12.66	≤23.98	PASS
11A	Ant2	5260	12.69	≤23.98	PASS
11A	Ant1	5300	12.62	≤23.98	PASS
11A	Ant2	5300	12.46	≤23.98	PASS
11A	Ant1	5320	12.47	≤23.98	PASS
11A	Ant2	5320	12.47	≤23.98	PASS
11N20MIMO	Ant1	5180	14.17	≤23.98	PASS
11N20MIMO	Ant2	5180	14.08	≤23.98	PASS
11N20MIMO	total	5180	17.14	≤23.98	PASS
11N20MIMO	Ant1	5220	13.62	≤23.98	PASS
11N20MIMO	Ant2	5220	13.59	≤23.98	PASS
11N20MIMO	total	5220	16.62	≤23.98	PASS
11N20MIMO	Ant1	5240	13.20	≤23.98	PASS
11N20MIMO	Ant2	5240	13.18	≤23.98	PASS
11N20MIMO	total	5240	16.20	≤23.98	PASS
11N20MIMO	Ant1	5260	12.56	≤23.98	PASS
11N20MIMO	Ant2	5260	12.53	≤23.98	PASS
11N20MIMO	total	5260	15.56	≤23.98	PASS
11N20MIMO	Ant1	5300	13.53	≤23.98	PASS
11N20MIMO	Ant2	5300	13.55	≤23.98	PASS
11N20MIMO	total	5300	16.55	≤23.98	PASS
11N20MIMO	Ant1	5320	13.28	≤23.98	PASS
11N20MIMO	Ant2	5320	13.41	≤23.98	PASS
11N20MIMO	total	5320	16.36	≤23.98	PASS
11N40MIMO	Ant1	5190	13.66	≤23.98	PASS
11N40MIMO	Ant2	5190	13.63	≤23.98	PASS
11N40MIMO	total	5190	16.66	≤23.98	PASS
11N40MIMO	Ant1	5230	12.83	≤23.98	PASS
11N40MIMO	Ant2	5230	12.80	≤23.98	PASS
11N40MIMO	total	5230	15.83	≤23.98	PASS
11N40MIMO	Ant1	5270	13.77	≤23.98	PASS

11N40MIMO	Ant2	5270	13.89	≤23.98	PASS
11N40MIMO	total	5270	16.84	≤23.98	PASS
11N40MIMO	Ant1	5310	13.62	≤23.98	PASS
11N40MIMO	Ant2	5310	13.62	≤23.98	PASS
11N40MIMO	total	5310	16.63	≤23.98	PASS
11AC20MIMO	Ant1	5180	14.31	≤23.98	PASS
11AC20MIMO	Ant2	5180	14.33	≤23.98	PASS
11AC20MIMO	total	5180	17.33	≤23.98	PASS
11AC20MIMO	Ant1	5220	13.60	≤23.98	PASS
11AC20MIMO	Ant2	5220	13.51	≤23.98	PASS
11AC20MIMO	total	5220	16.57	≤23.98	PASS
11AC20MIMO	Ant1	5240	13.13	≤23.98	PASS
11AC20MIMO	Ant2	5240	13.13	≤23.98	PASS
11AC20MIMO	total	5240	16.14	≤23.98	PASS
11AC20MIMO	Ant1	5260	12.57	≤23.98	PASS
11AC20MIMO	Ant2	5260	12.56	≤23.98	PASS
11AC20MIMO	total	5260	15.58	≤23.98	PASS
11AC20MIMO	Ant1	5300	12.45	≤23.98	PASS
11AC20MIMO	Ant2	5300	12.37	≤23.98	PASS
11AC20MIMO	total	5300	15.42	≤23.98	PASS
11AC20MIMO	Ant1	5320	12.43	≤23.98	PASS
11AC20MIMO	Ant2	5320	12.43	≤23.98	PASS
11AC20MIMO	total	5320	15.44	≤23.98	PASS
11AC40MIMO	Ant1	5190	14.53	≤23.98	PASS
11AC40MIMO	Ant2	5190	14.56	≤23.98	PASS
11AC40MIMO	total	5190	17.56	≤23.98	PASS
11AC40MIMO	Ant1	5230	13.66	≤23.98	PASS
11AC40MIMO	Ant2	5230	13.76	≤23.98	PASS
11AC40MIMO	total	5230	16.72	≤23.98	PASS
11AC40MIMO	Ant1	5270	13.25	≤23.98	PASS
11AC40MIMO	Ant2	5270	13.23	≤23.98	PASS
11AC40MIMO	total	5270	16.25	≤23.98	PASS
11AC40MIMO	Ant1	5310	13.08	≤23.98	PASS
11AC40MIMO	Ant2	5310	13.04	≤23.98	PASS
11AC40MIMO	total	5310	16.07	≤23.98	PASS
11AC80MIMO	Ant1	5210	13.97	≤23.98	PASS
11AC80MIMO	Ant2	5210	13.93	≤23.98	PASS
11AC80MIMO	total	5210	16.96	≤23.98	PASS
11AC80MIMO	Ant1	5290	13.13	≤23.98	PASS
11AC80MIMO	Ant2	5290	13.26	≤23.98	PASS
11AC80MIMO	total	5290	16.21	≤23.98	PASS
11AX20MIMO	Ant1	5180	14.08	≤23.98	PASS

11AX20MIMO	Ant2	5180	14.07	≤23.98	PASS
11AX20MIMO	total	5180	17.09	≤23.98	PASS
11AX20MIMO	Ant1	5220	13.59	≤23.98	PASS
11AX20MIMO	Ant2	5220	13.60	≤23.98	PASS
11AX20MIMO	total	5220	16.61	≤23.98	PASS
11AX20MIMO	Ant1	5240	13.14	≤23.98	PASS
11AX20MIMO	Ant2	5240	13.12	≤23.98	PASS
11AX20MIMO	total	5240	16.14	≤23.98	PASS
11AX20MIMO	Ant1	5260	13.49	≤23.98	PASS
11AX20MIMO	Ant2	5260	13.38	≤23.98	PASS
11AX20MIMO	total	5260	16.45	≤23.98	PASS
11AX20MIMO	Ant1	5300	13.48	≤23.98	PASS
11AX20MIMO	Ant2	5300	13.48	≤23.98	PASS
11AX20MIMO	total	5300	16.49	≤23.98	PASS
11AX20MIMO	Ant1	5320	13.35	≤23.98	PASS
11AX20MIMO	Ant2	5320	13.27	≤23.98	PASS
11AX20MIMO	total	5320	16.32	≤23.98	PASS
11AX40MIMO	Ant1	5190	14.45	≤23.98	PASS
11AX40MIMO	Ant2	5190	14.53	≤23.98	PASS
11AX40MIMO	total	5190	17.50	≤23.98	PASS
11AX40MIMO	Ant1	5230	13.35	≤23.98	PASS
11AX40MIMO	Ant2	5230	13.51	≤23.98	PASS
11AX40MIMO	total	5230	16.44	≤23.98	PASS
11AX40MIMO	Ant1	5270	12.78	≤23.98	PASS
11AX40MIMO	Ant2	5270	12.88	≤23.98	PASS
11AX40MIMO	total	5270	15.84	≤23.98	PASS
11AX40MIMO	Ant1	5310	12.75	≤23.98	PASS
11AX40MIMO	Ant2	5310	12.93	≤23.98	PASS
11AX40MIMO	total	5310	15.85	≤23.98	PASS
11AX80MIMO	Ant1	5210	13.39	≤23.98	PASS
11AX80MIMO	Ant2	5210	13.59	≤23.98	PASS
11AX80MIMO	total	5210	16.50	≤23.98	PASS
11AX80MIMO	Ant1	5290	13.06	≤23.98	PASS
11AX80MIMO	Ant2	5290	13.00	≤23.98	PASS
11AX80MIMO	total	5290	16.04	≤23.98	PASS

Note: 1.The cable loss are compensated in the graph.


Test Graphs Channel Power

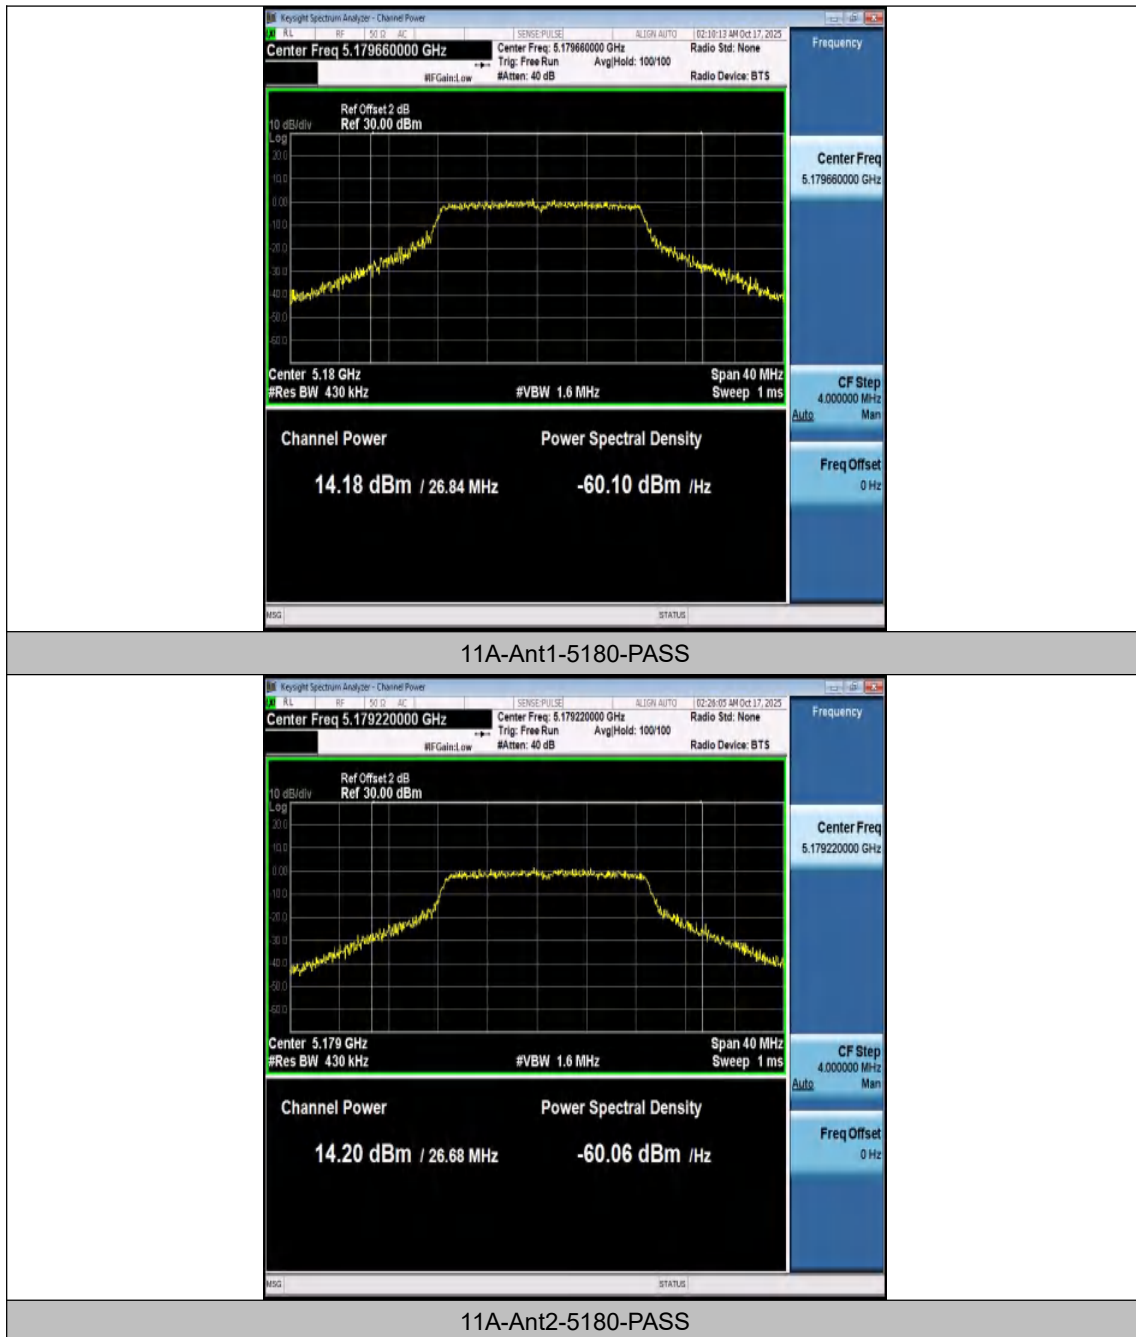

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

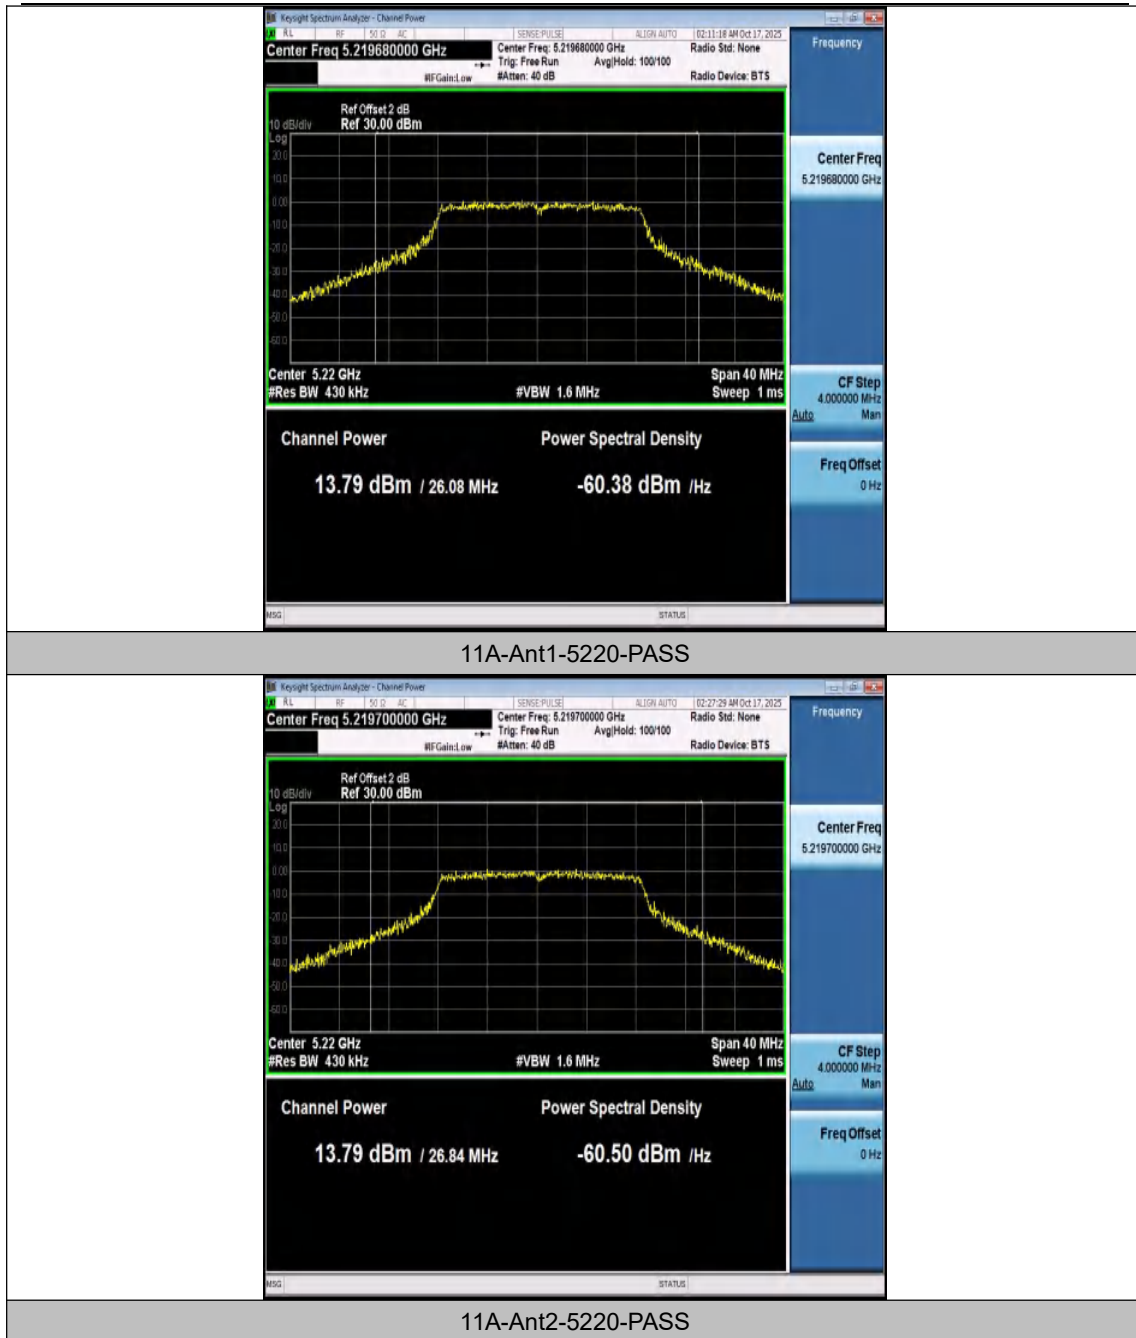



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

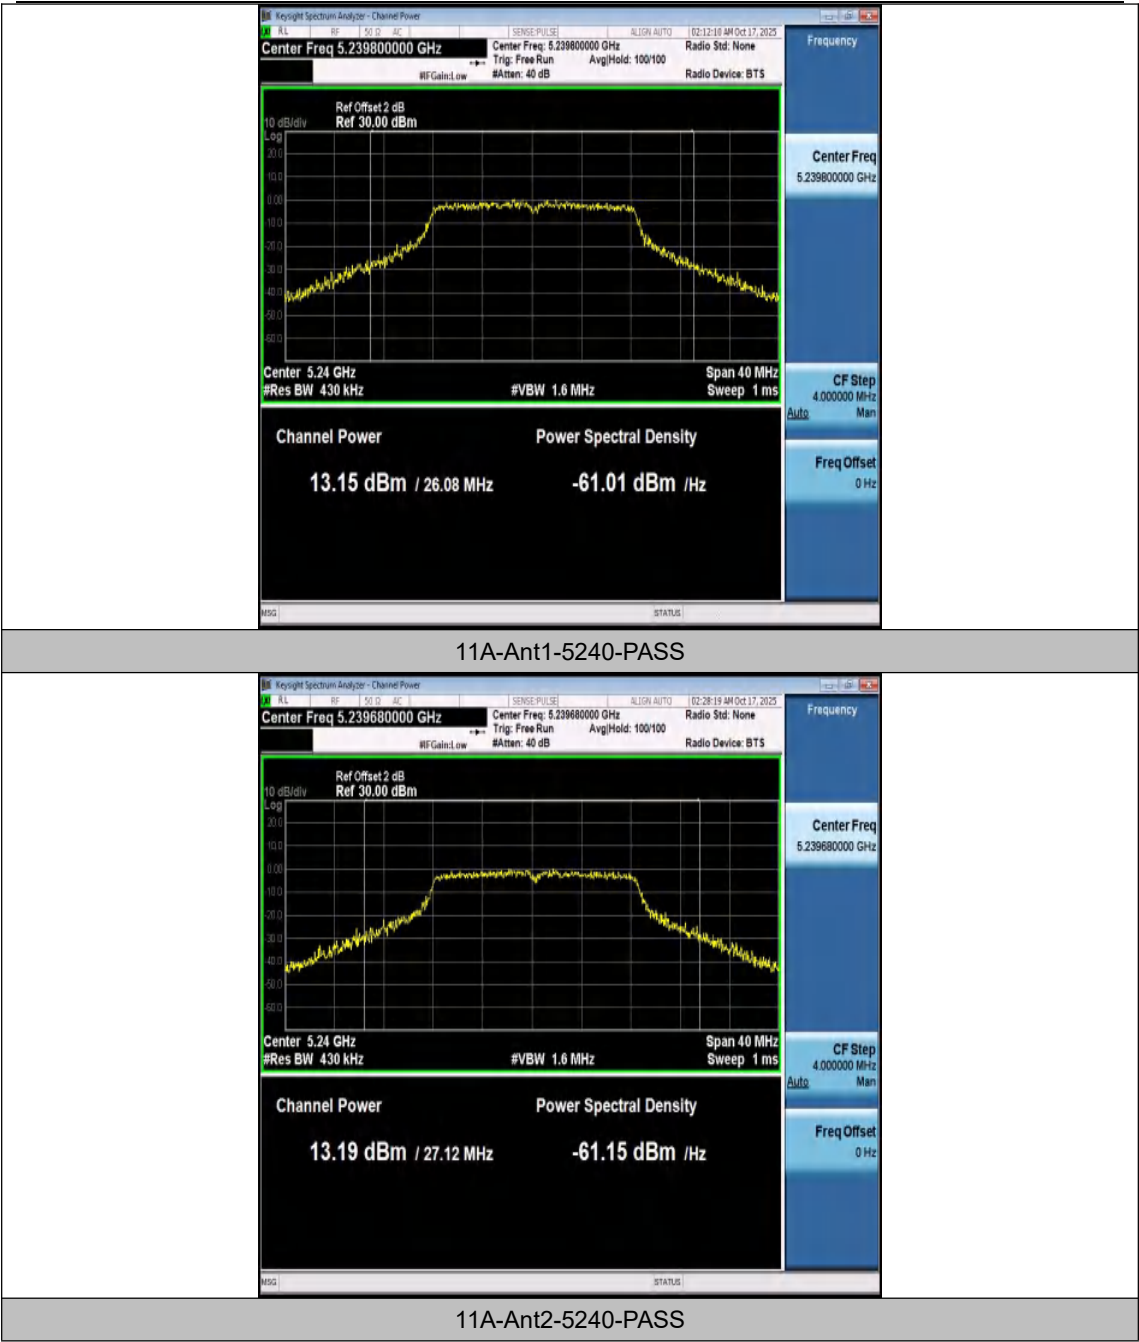


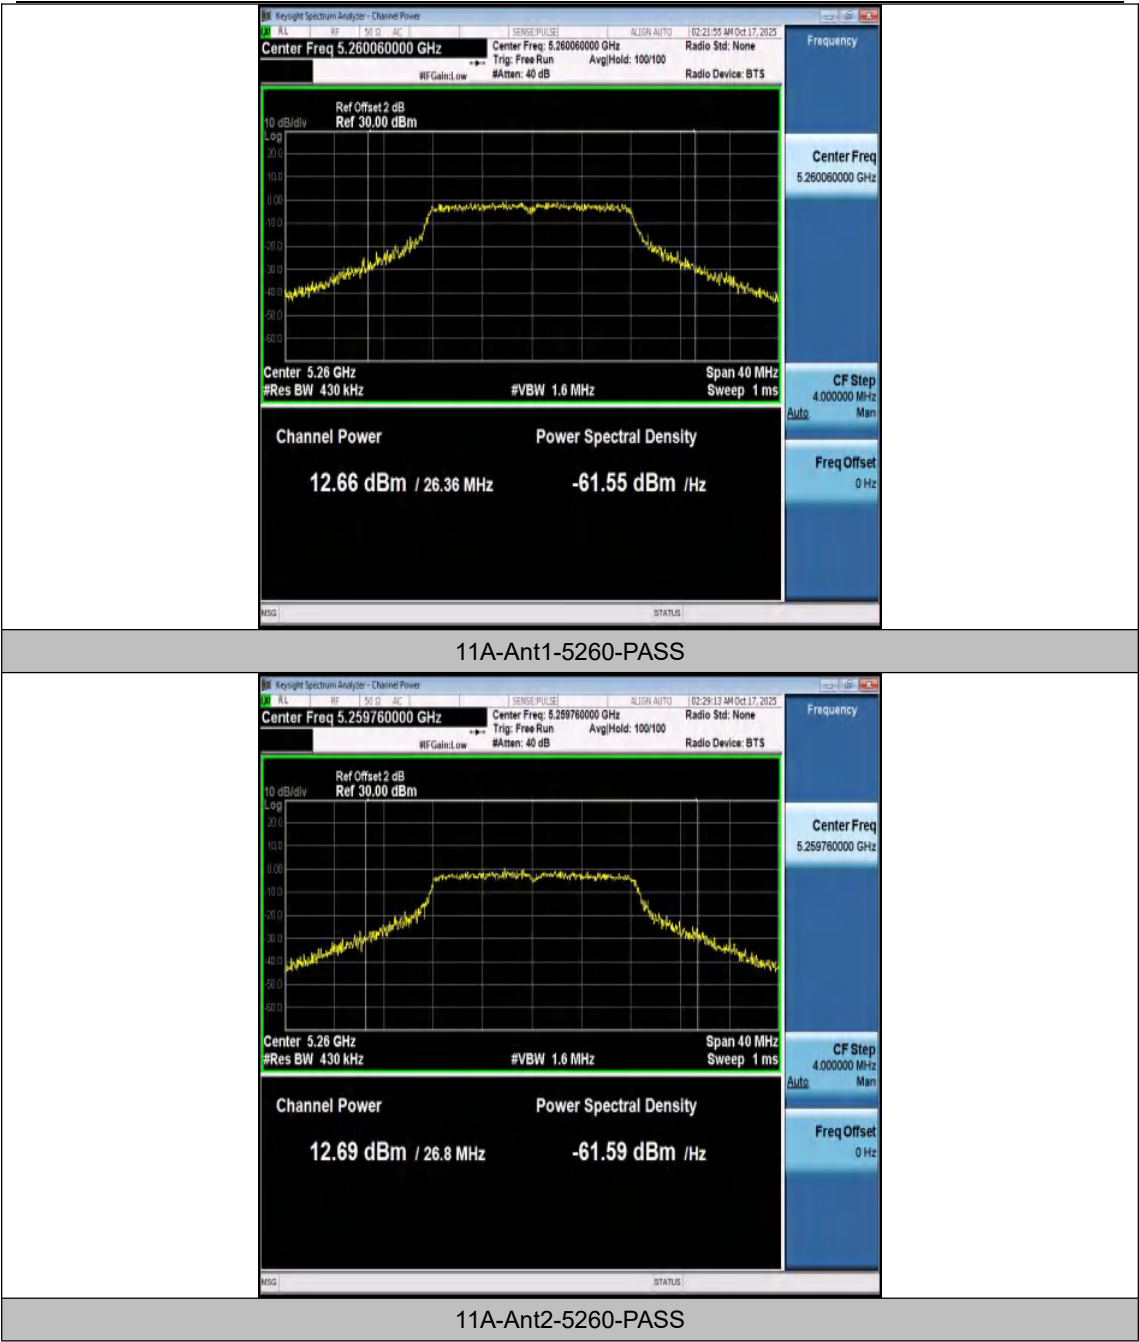

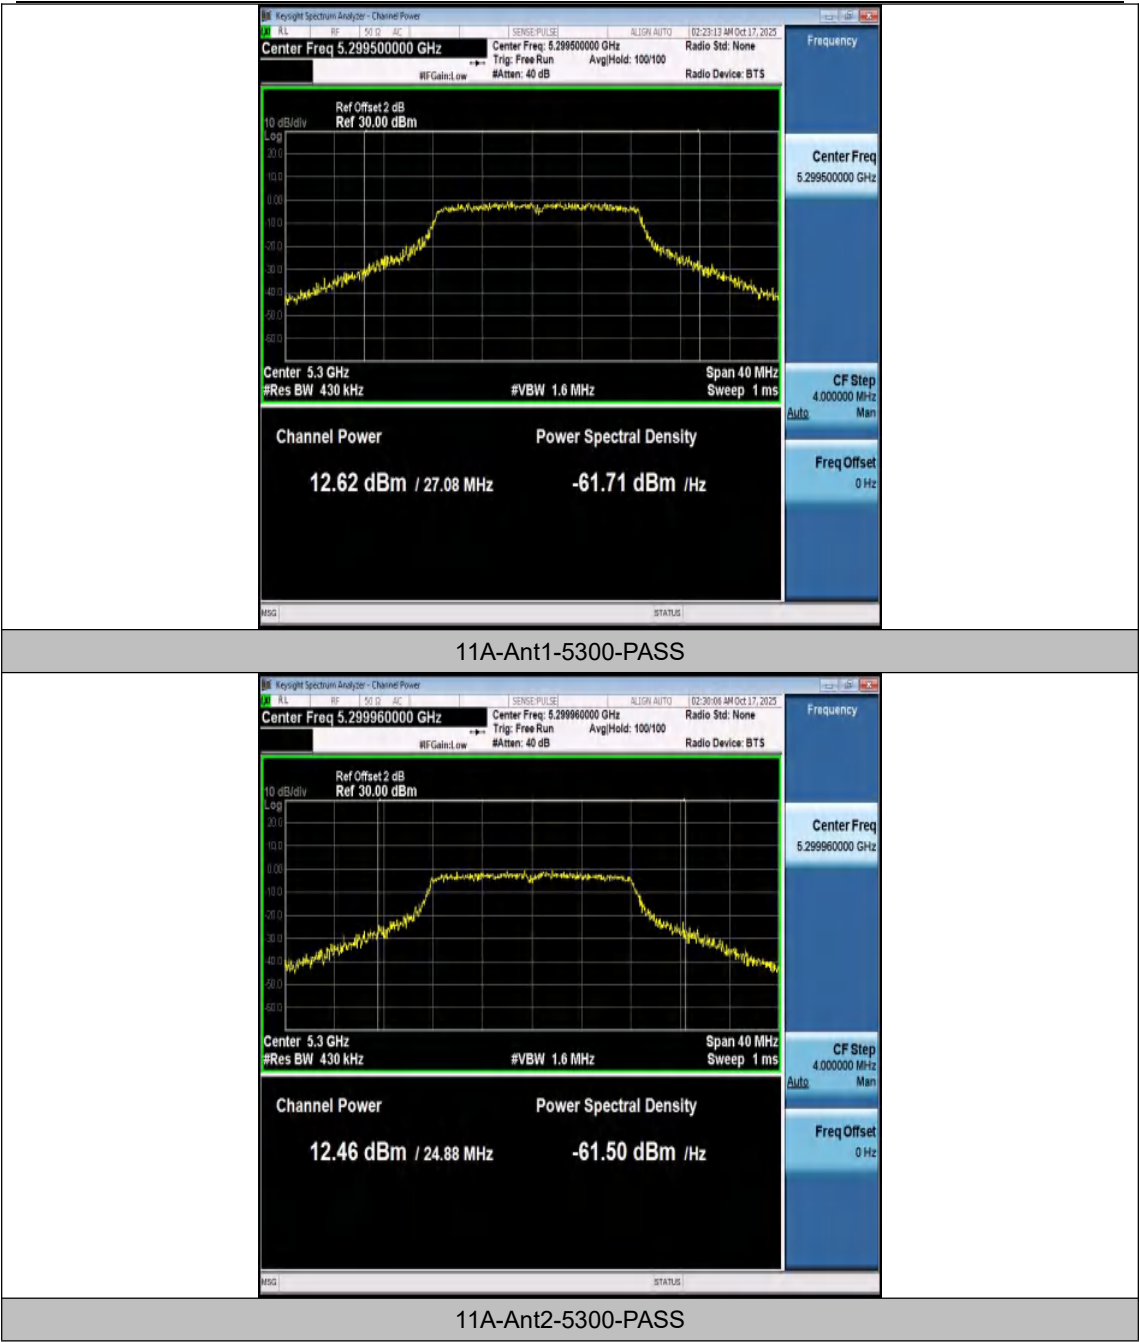

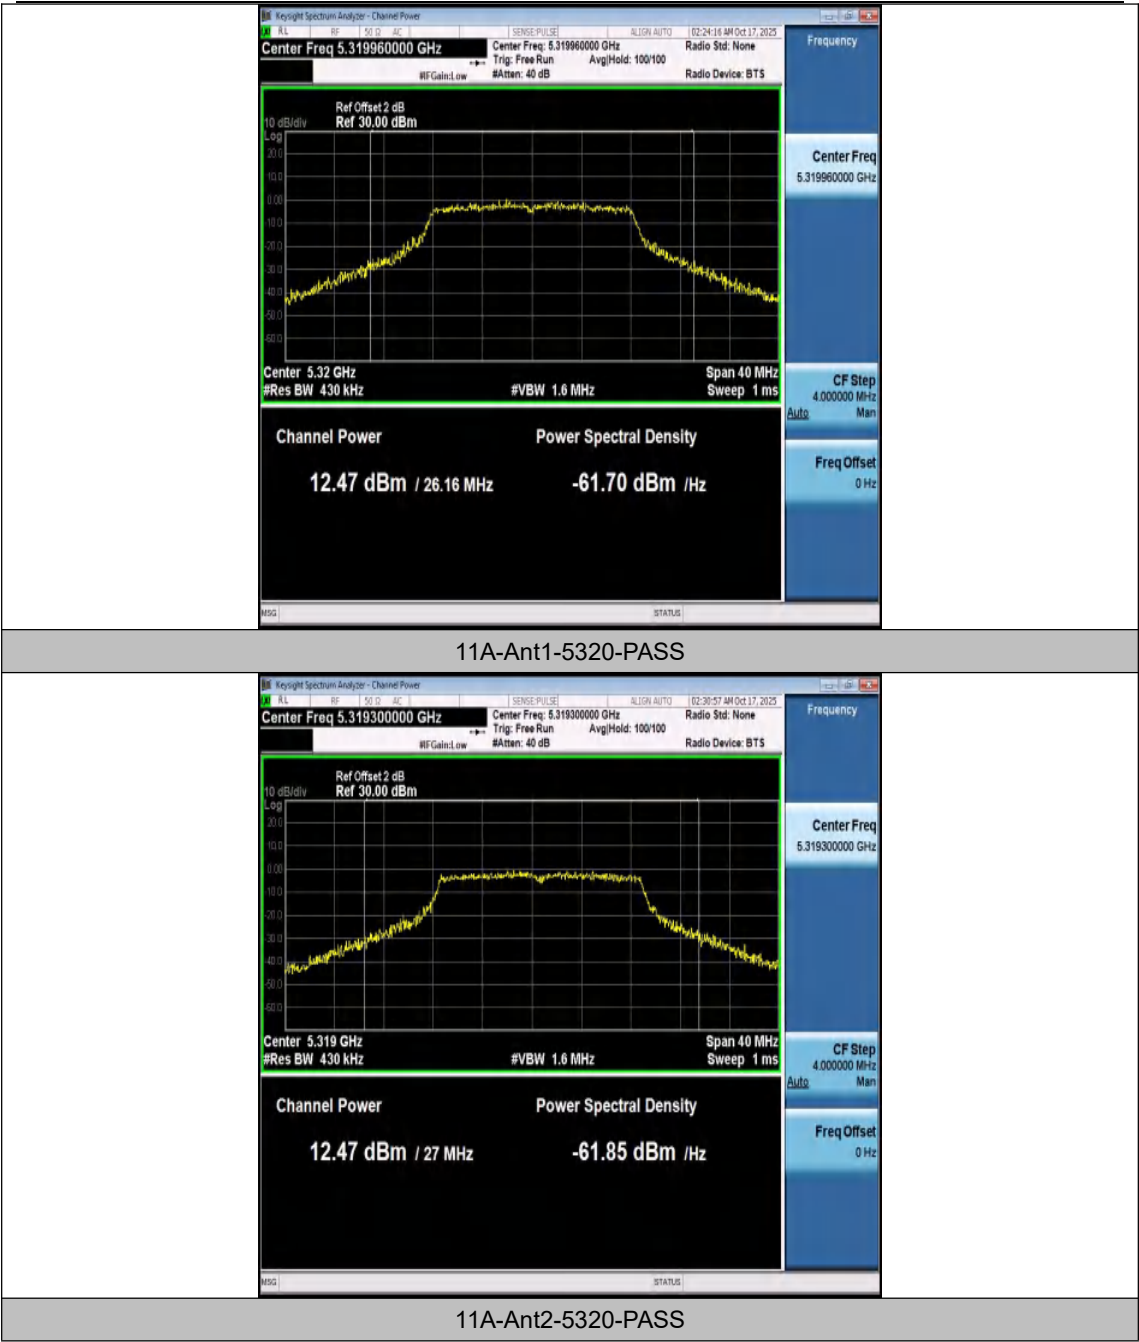

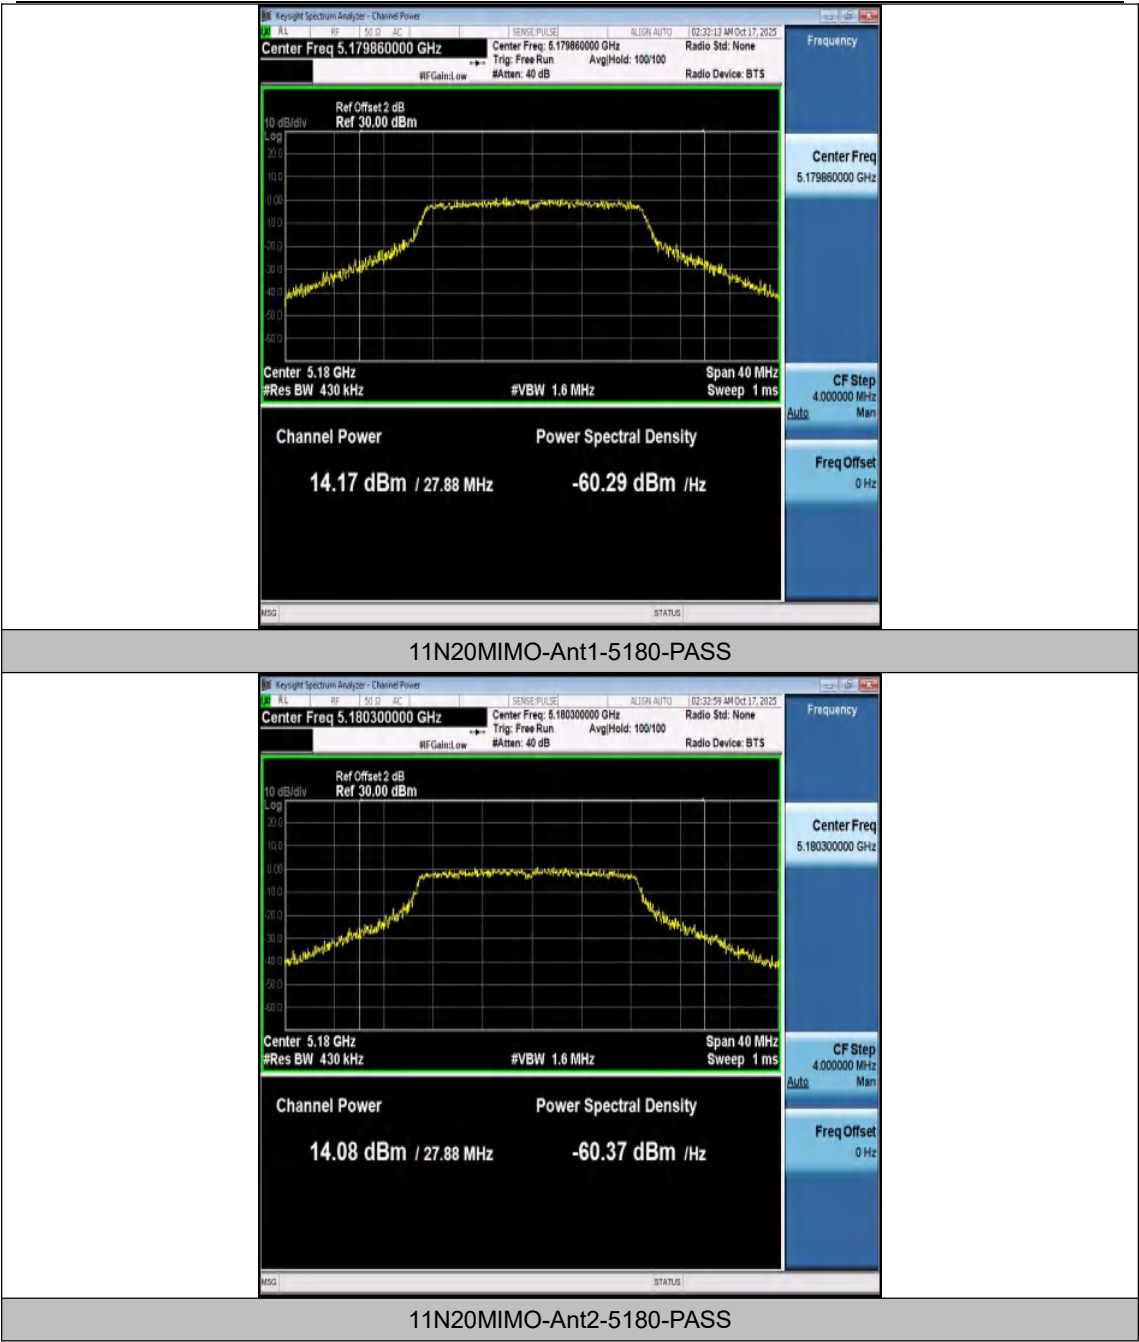


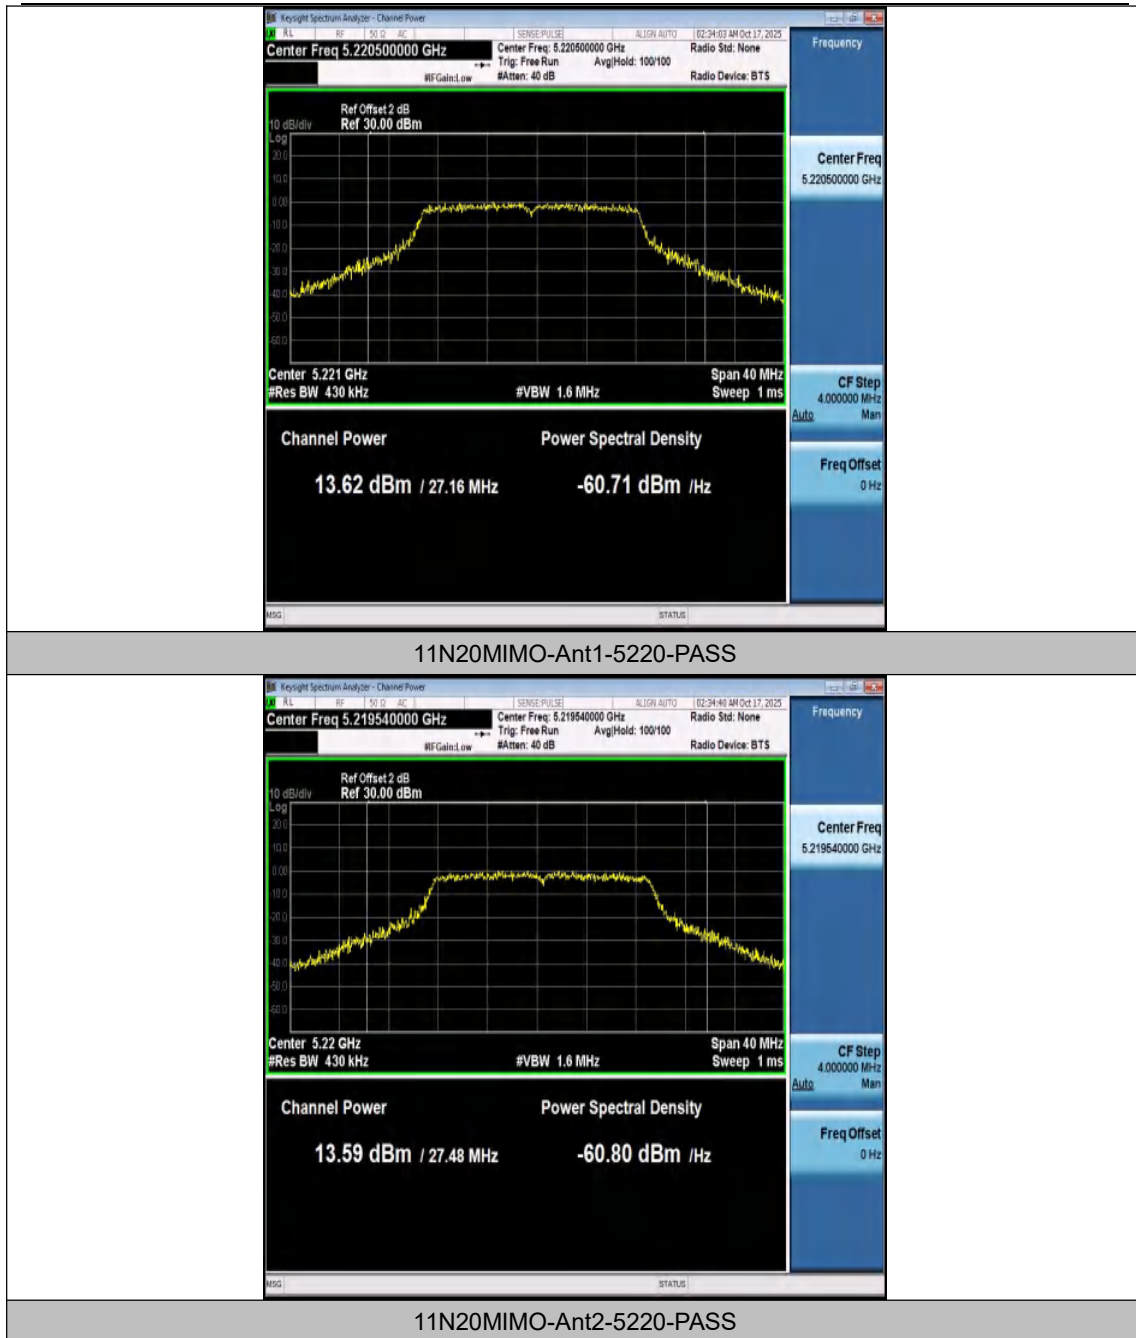



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

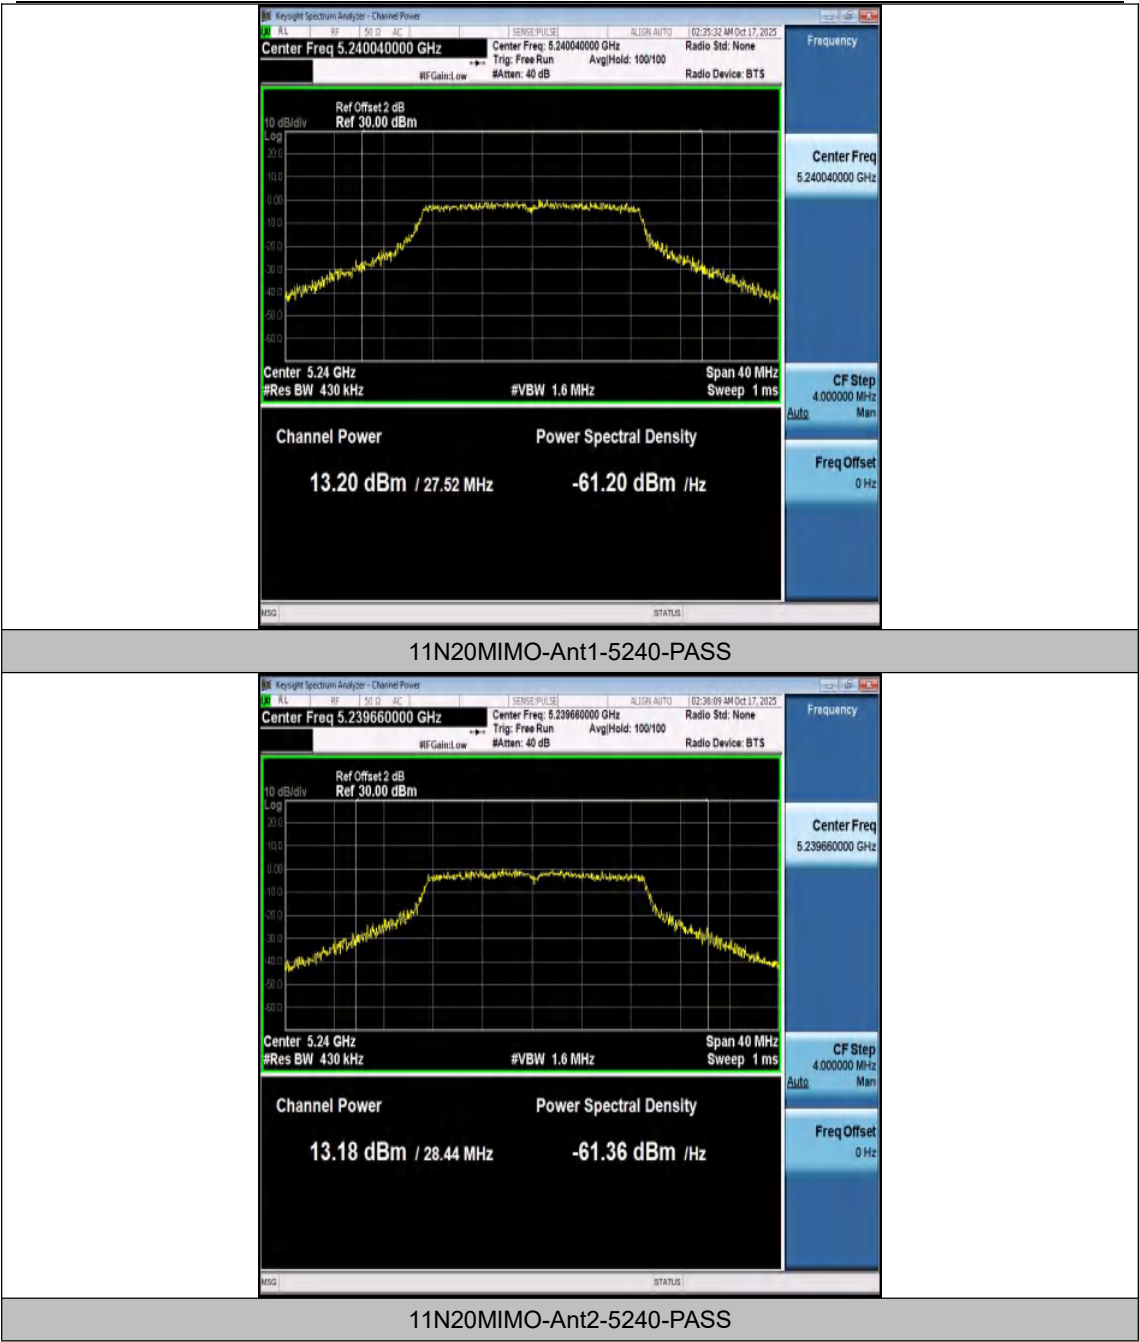


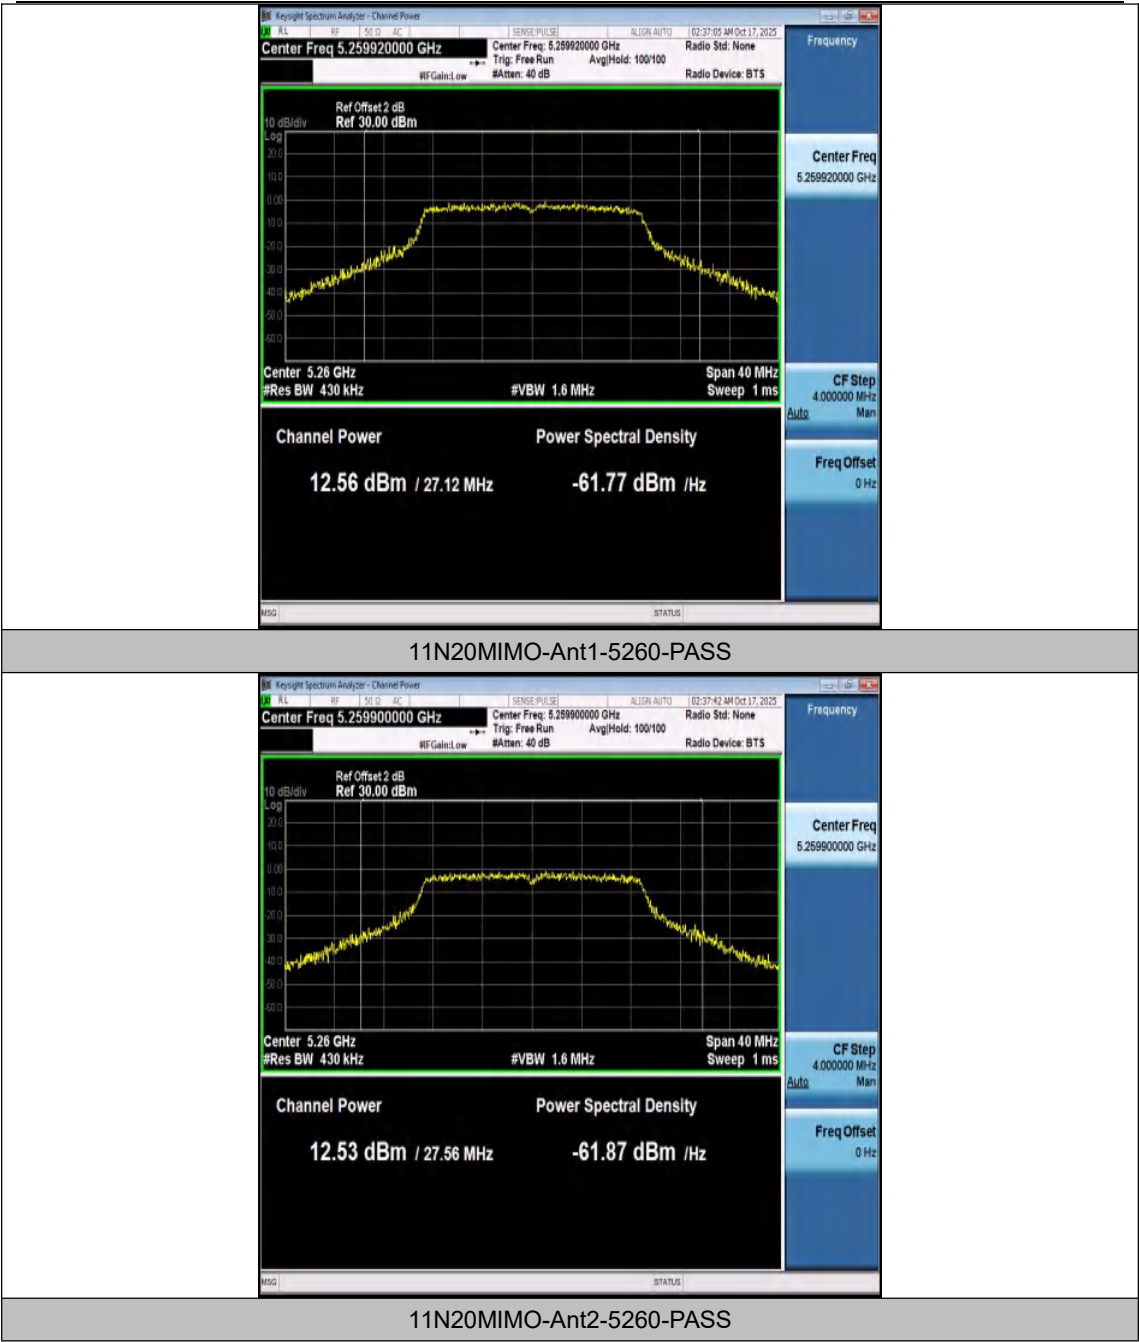


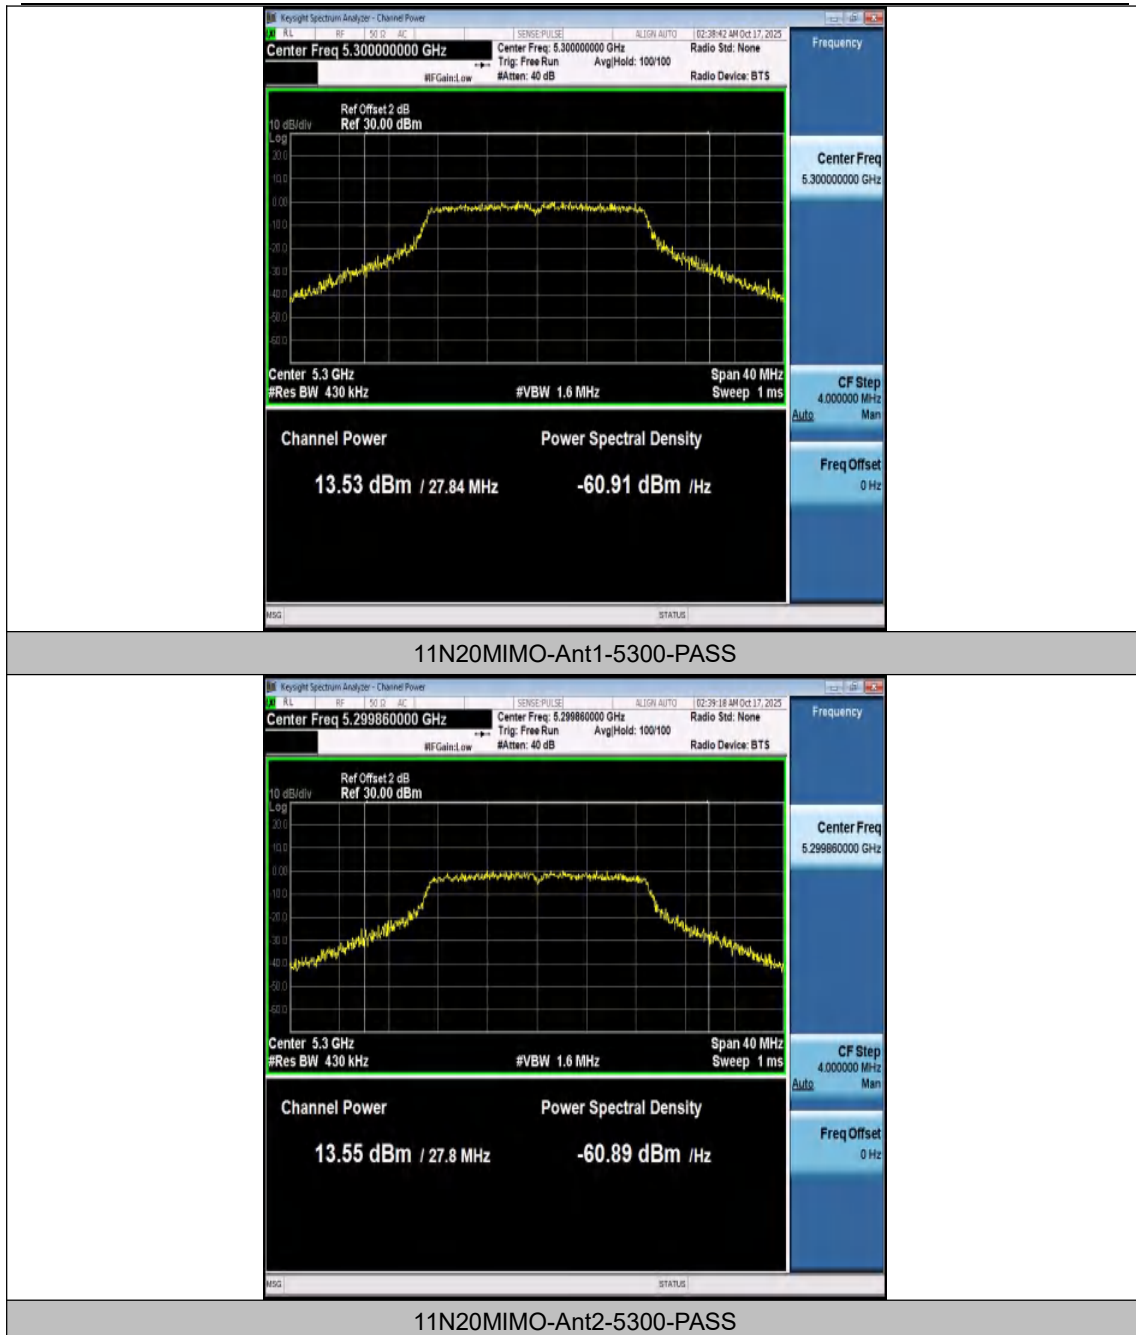


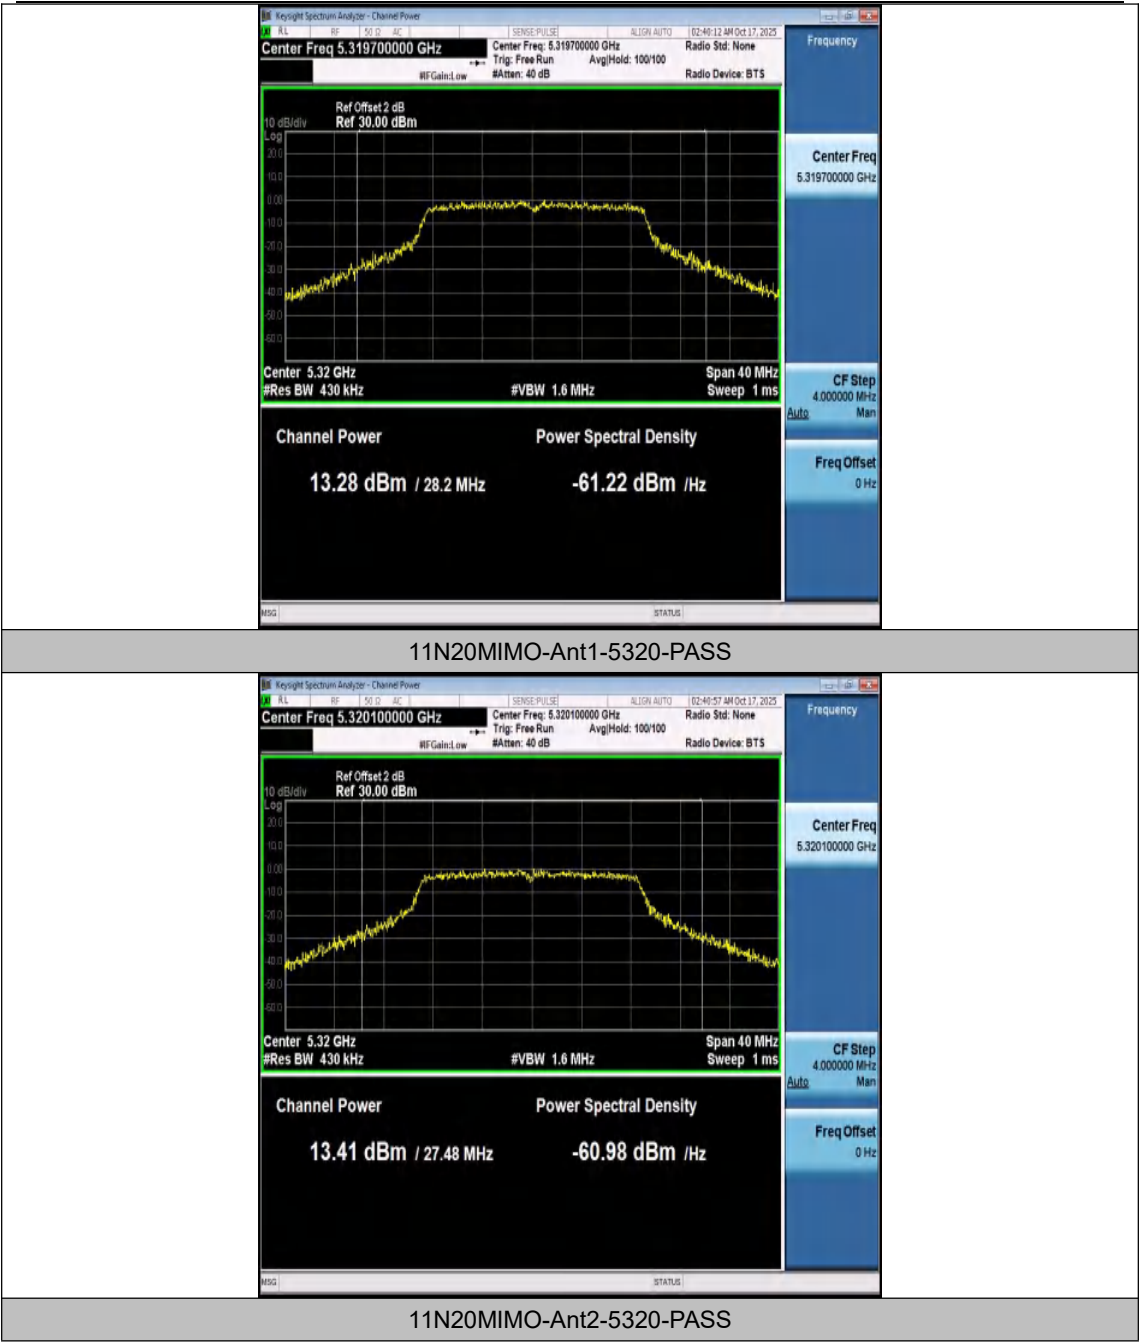


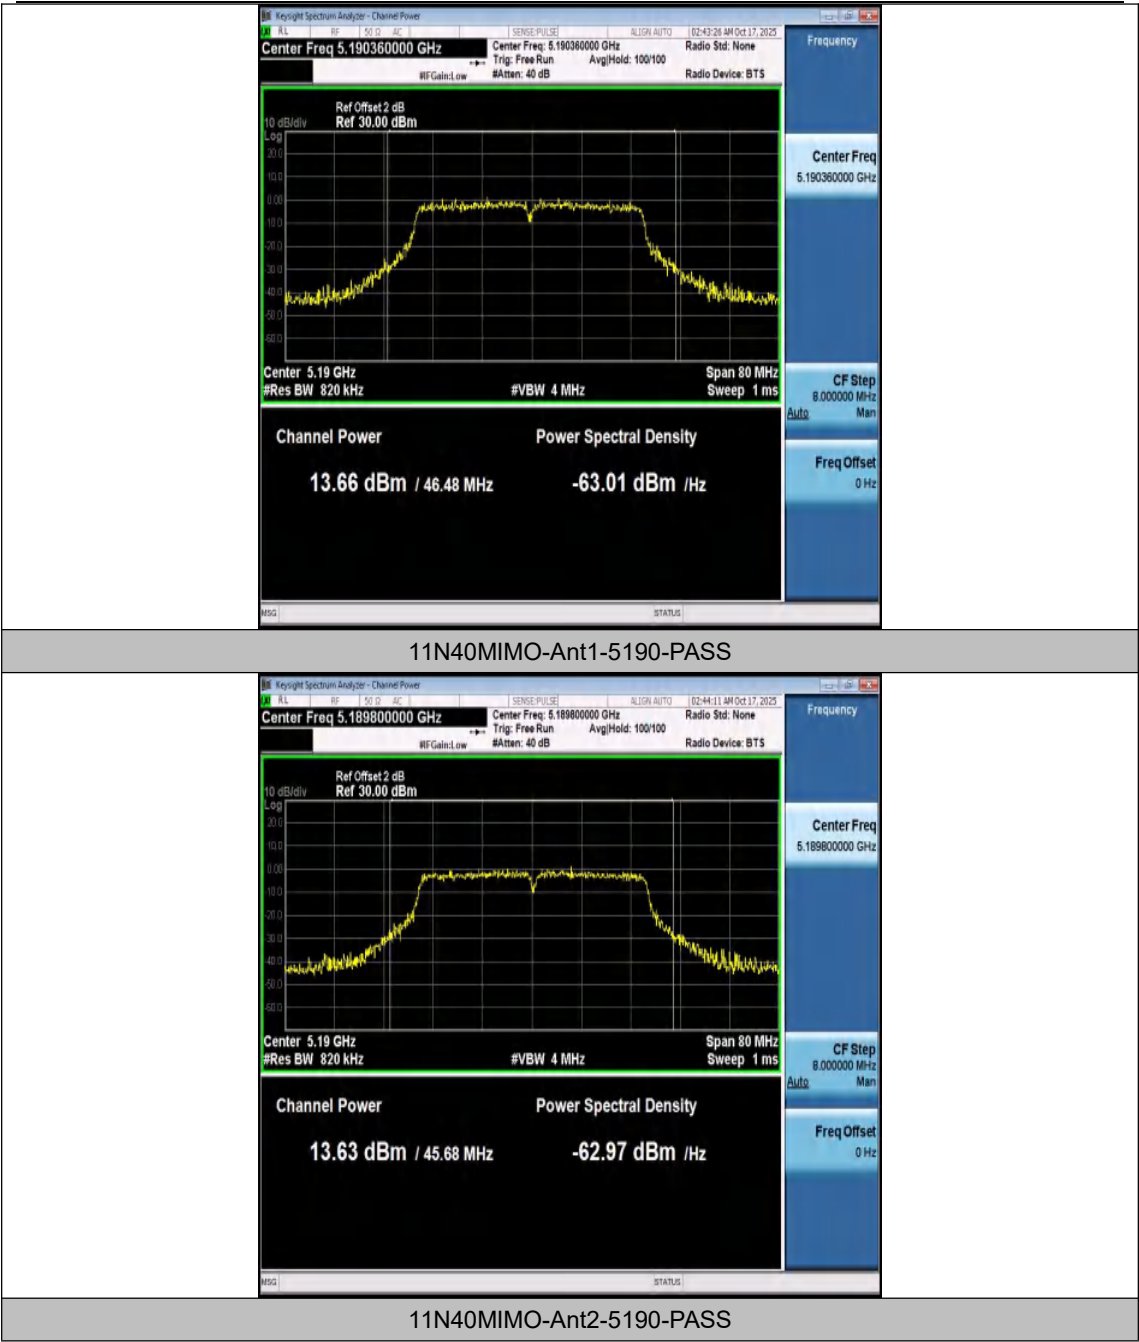


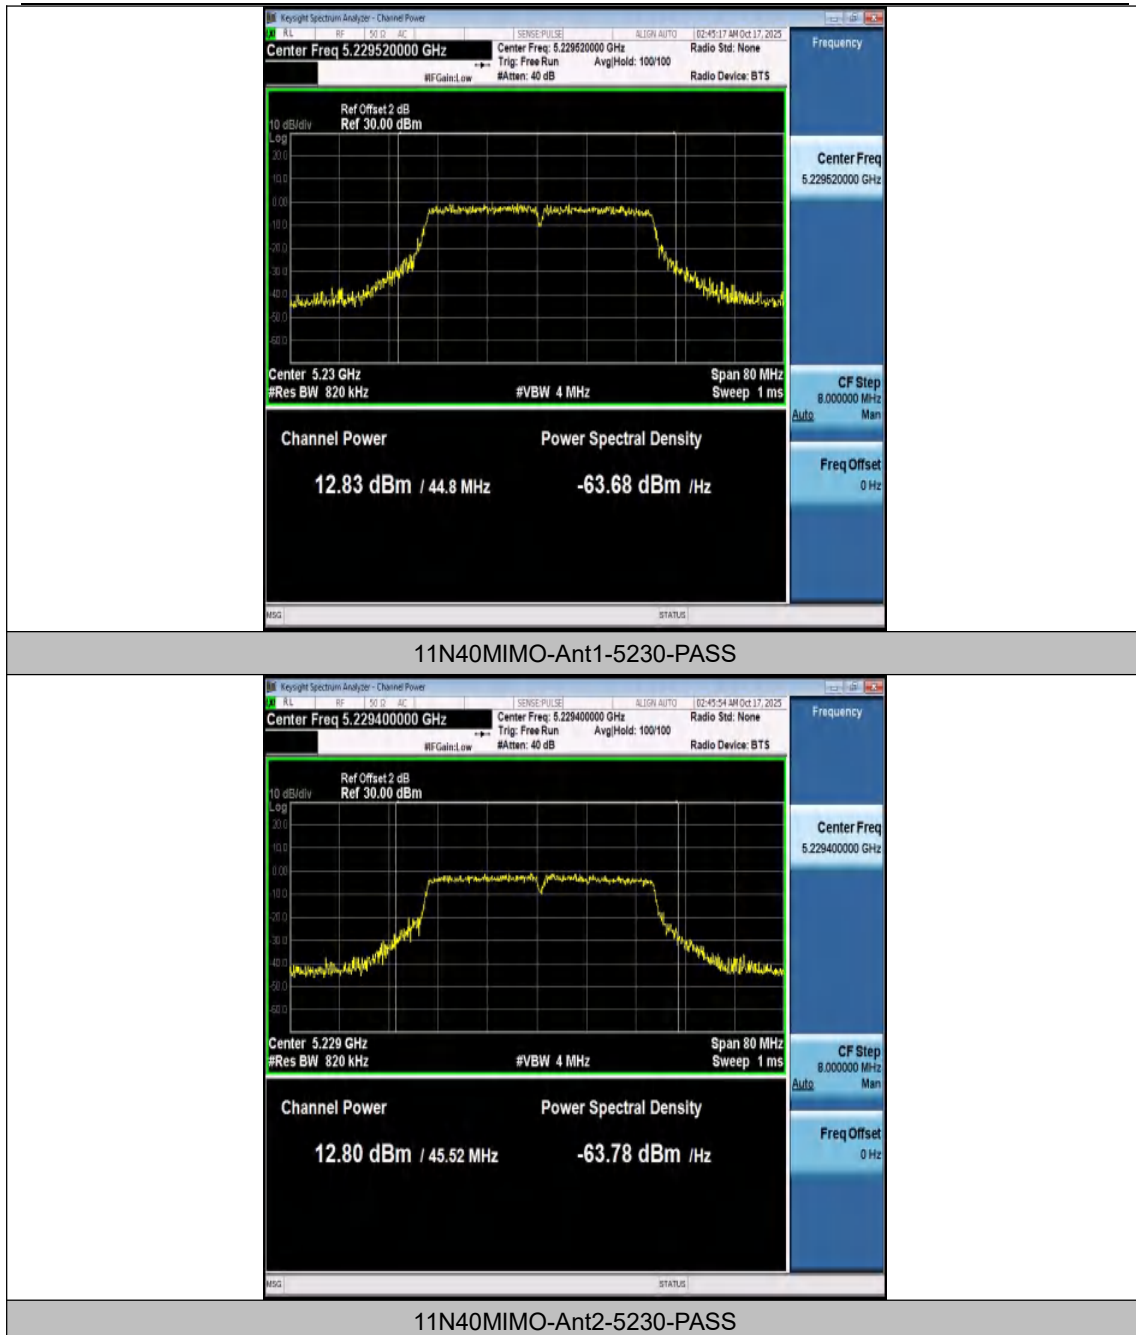


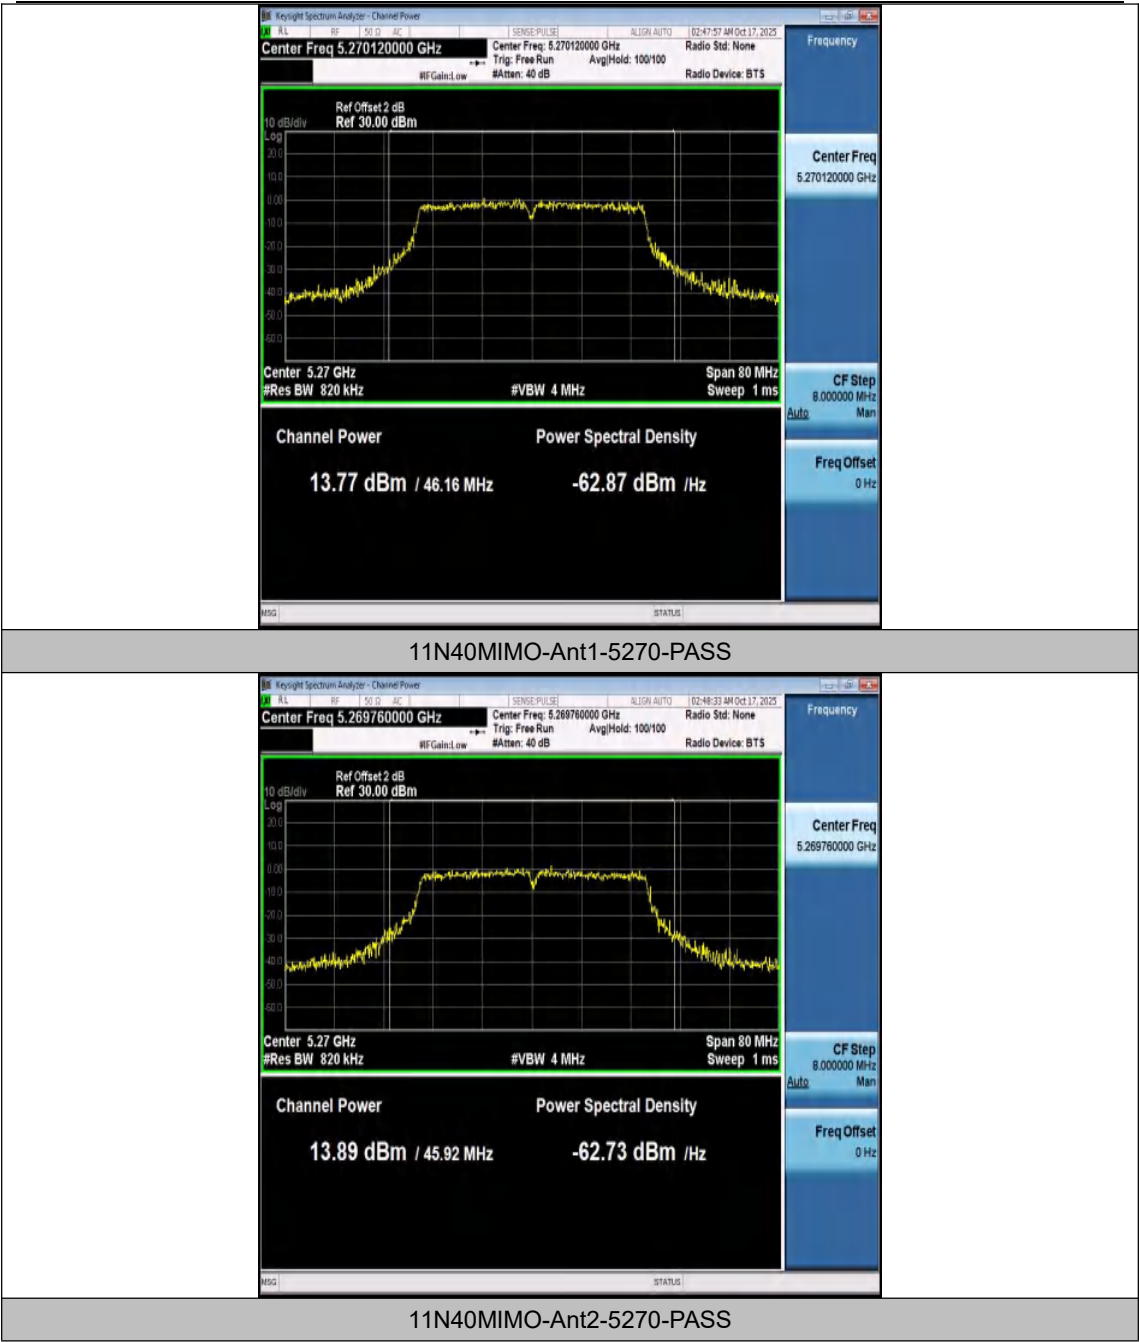

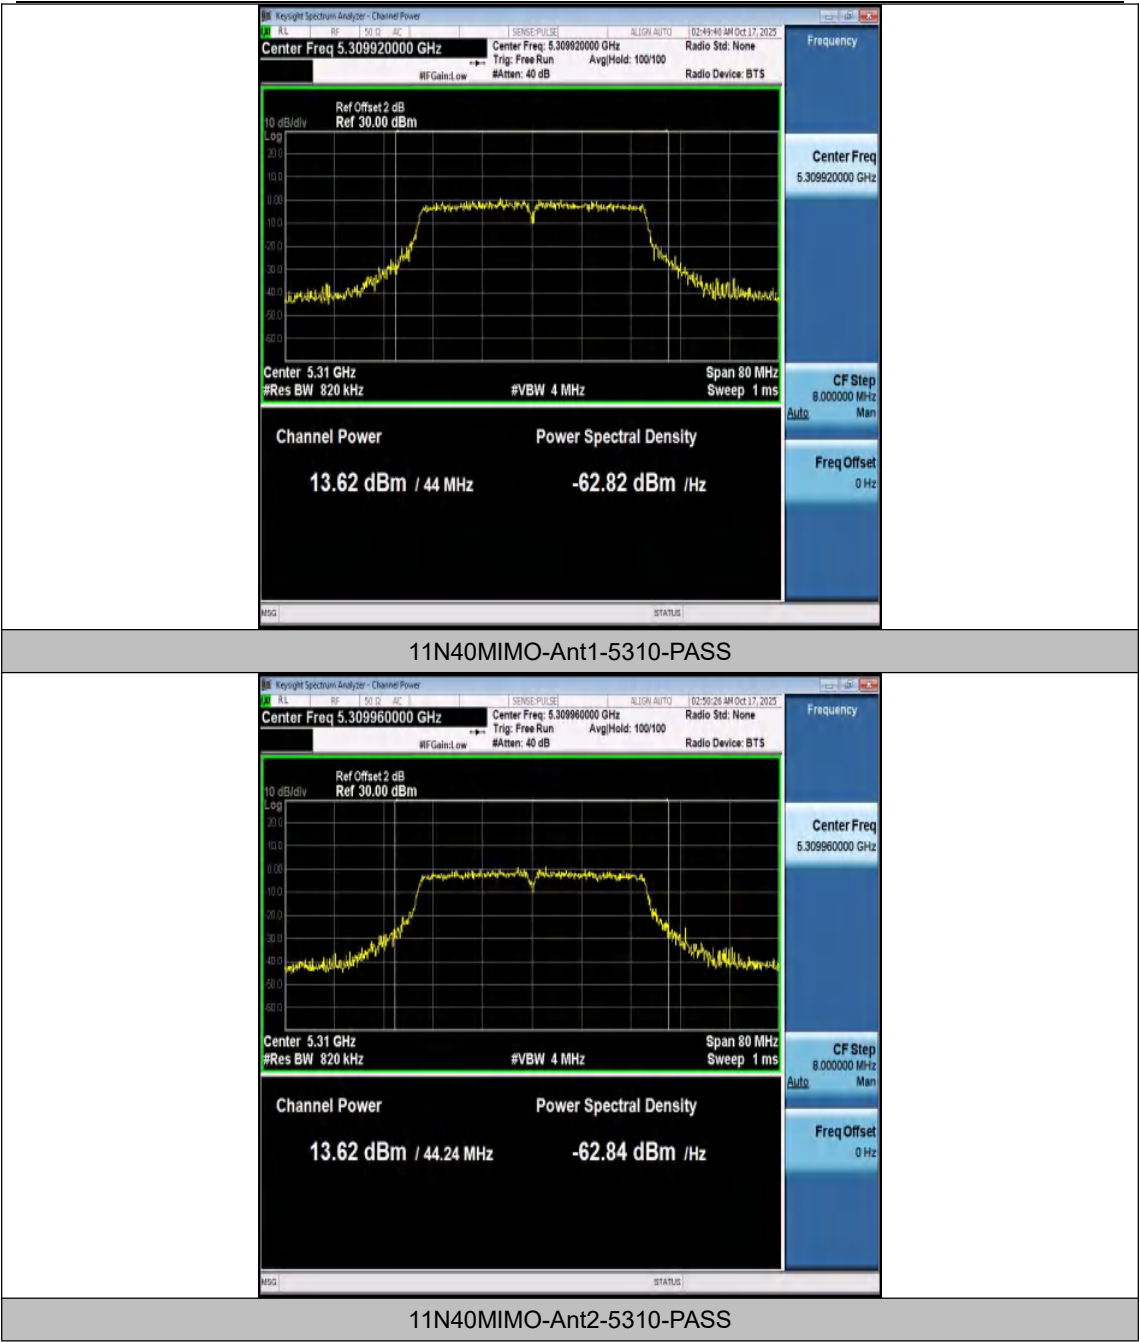

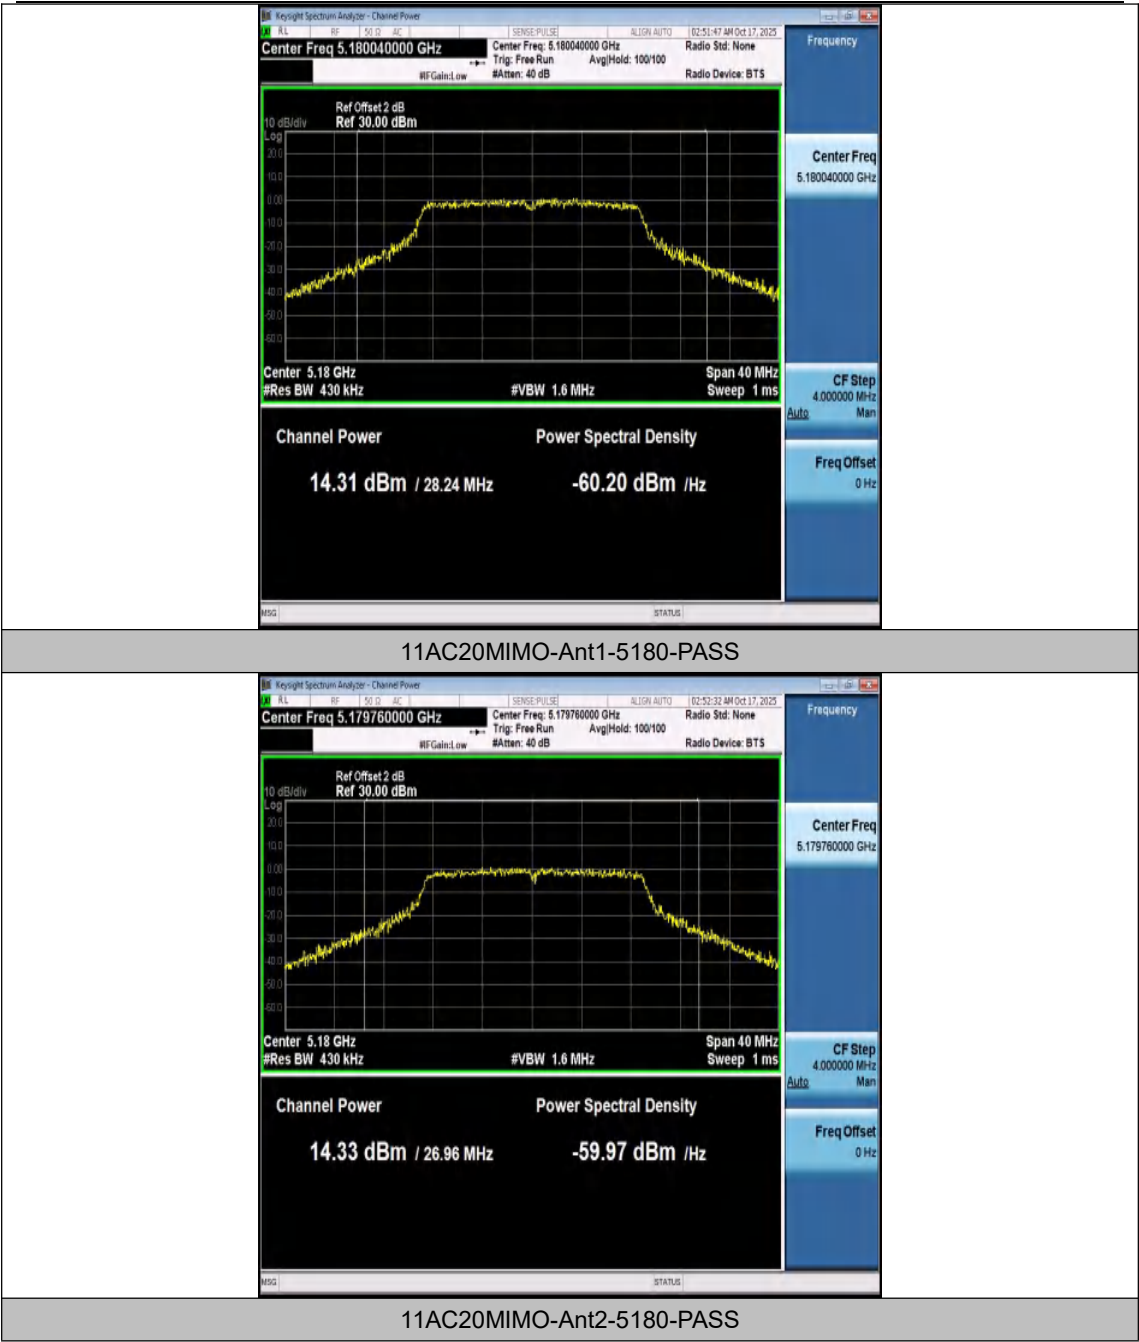

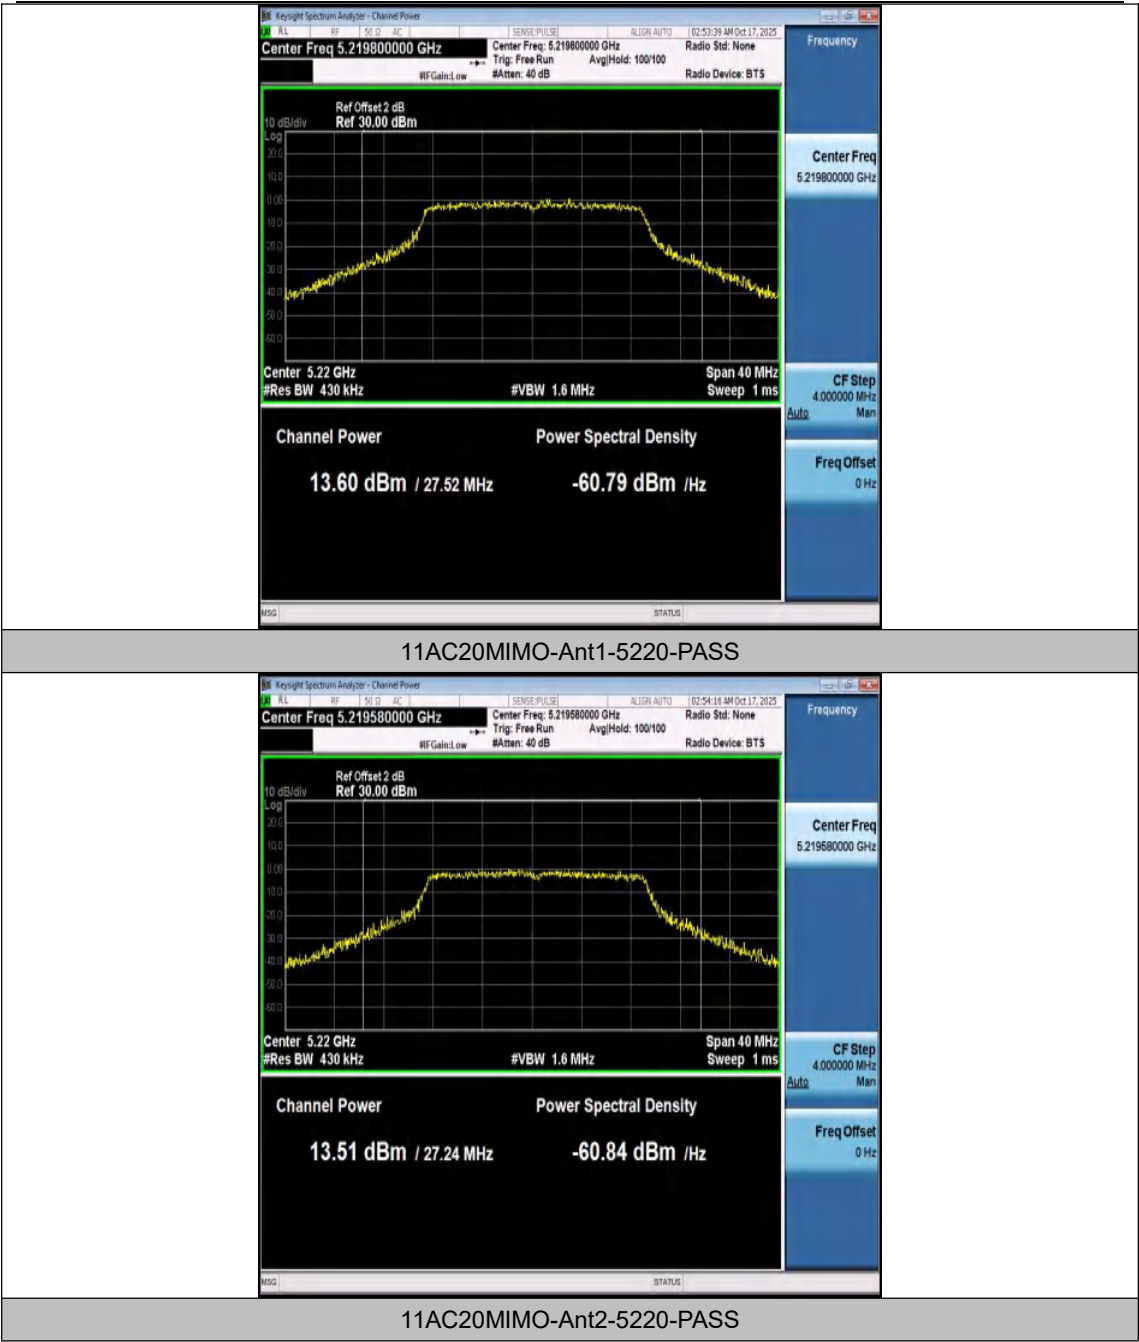


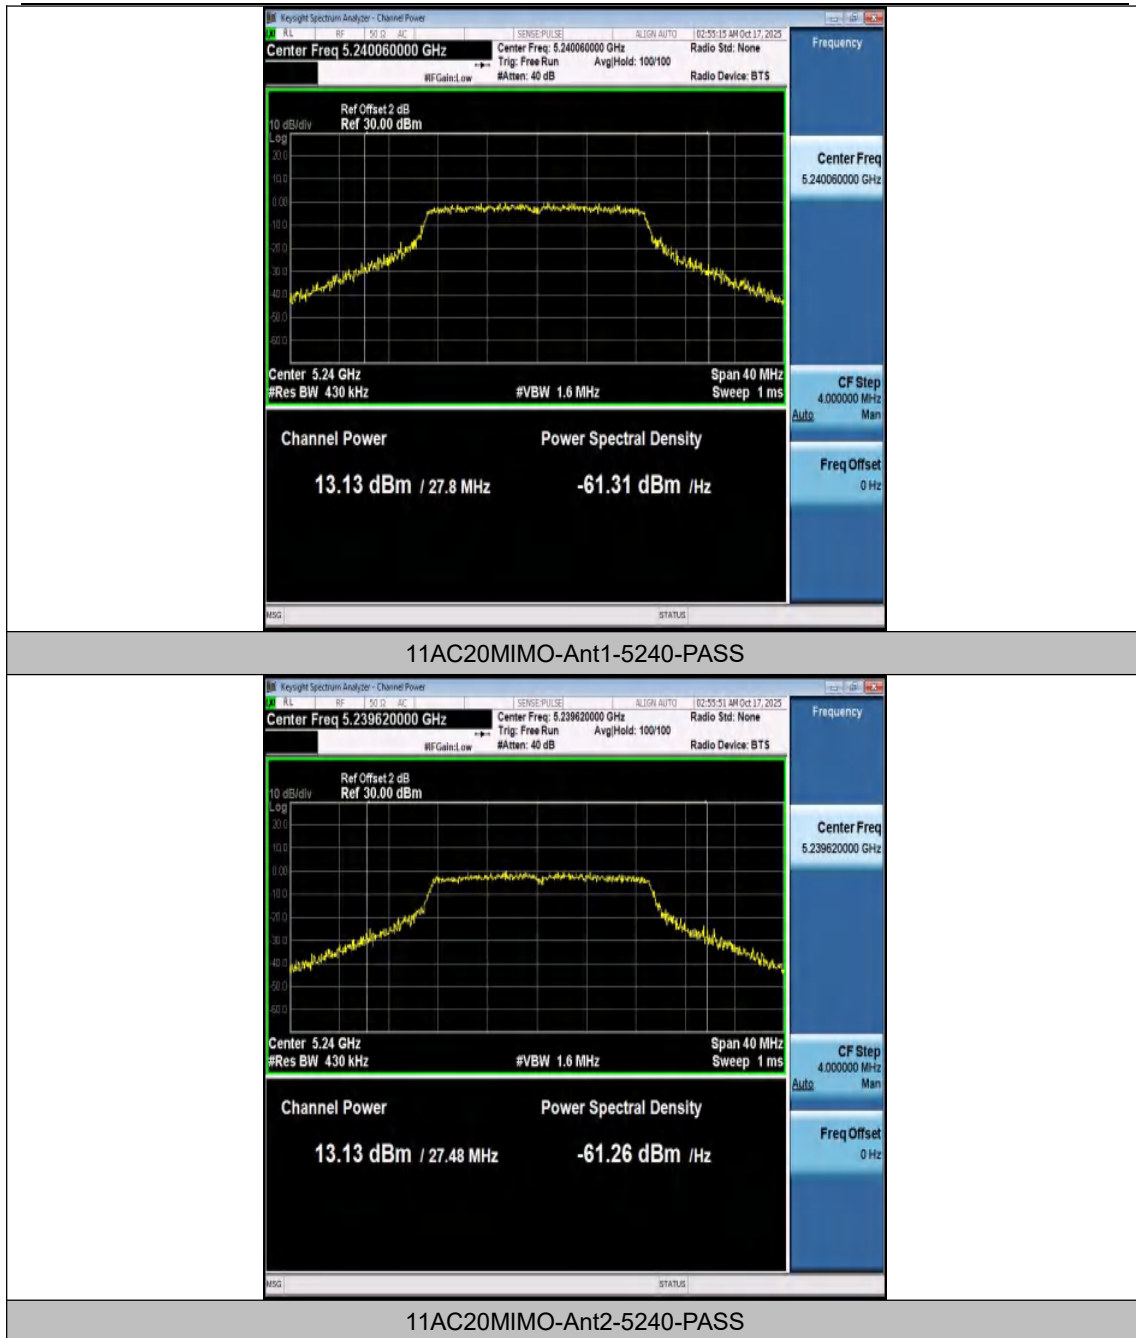



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

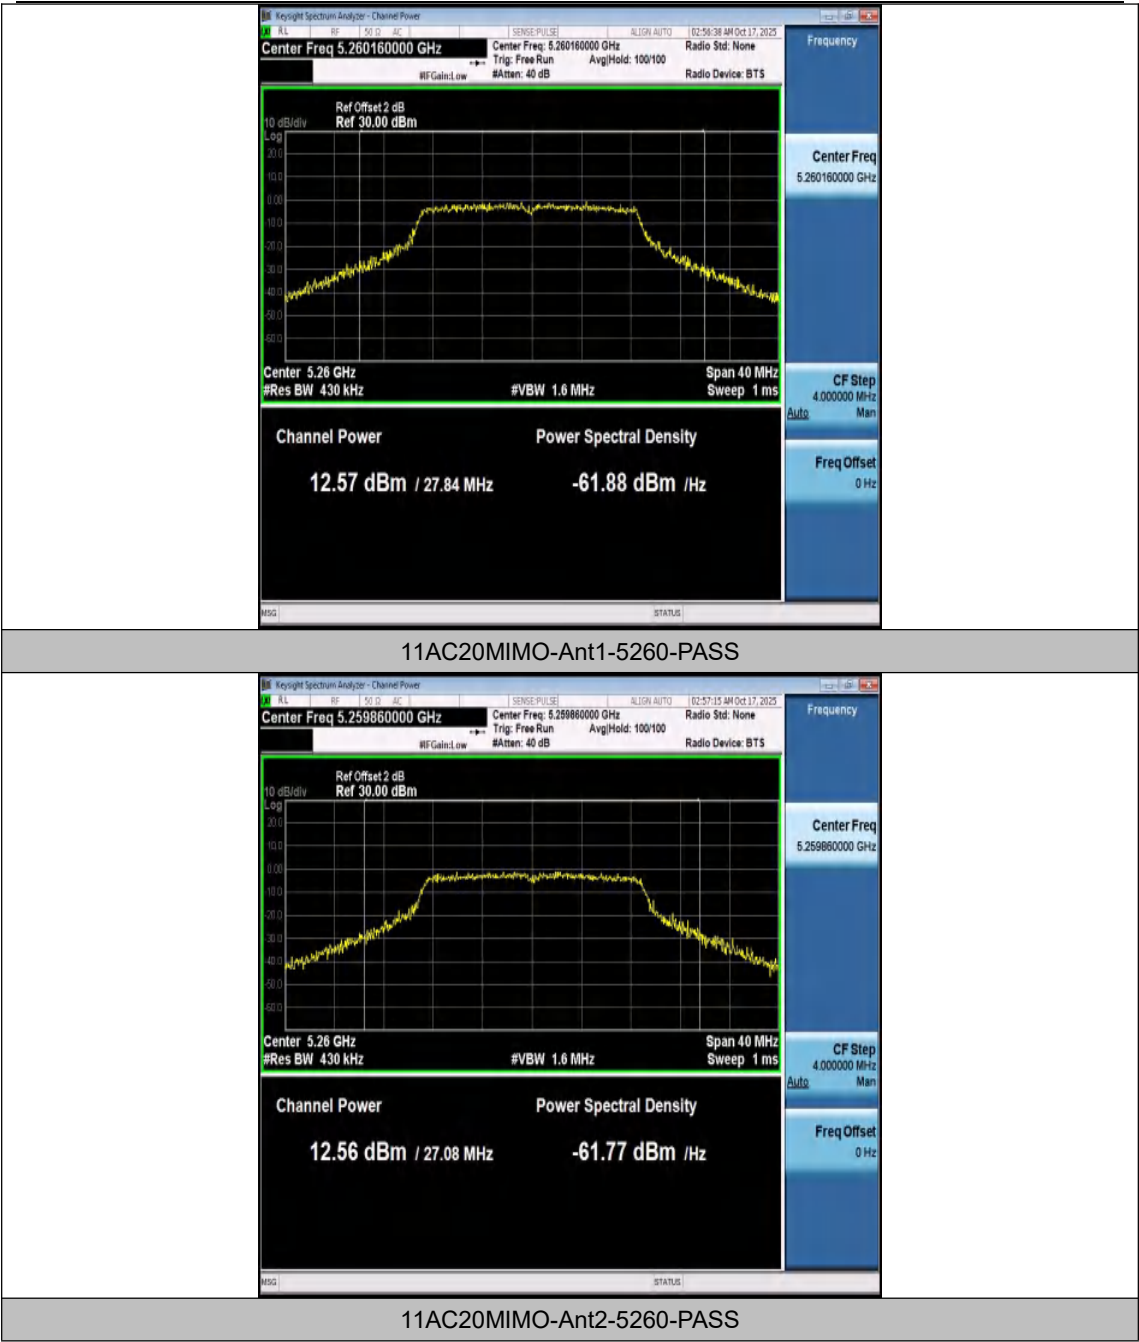


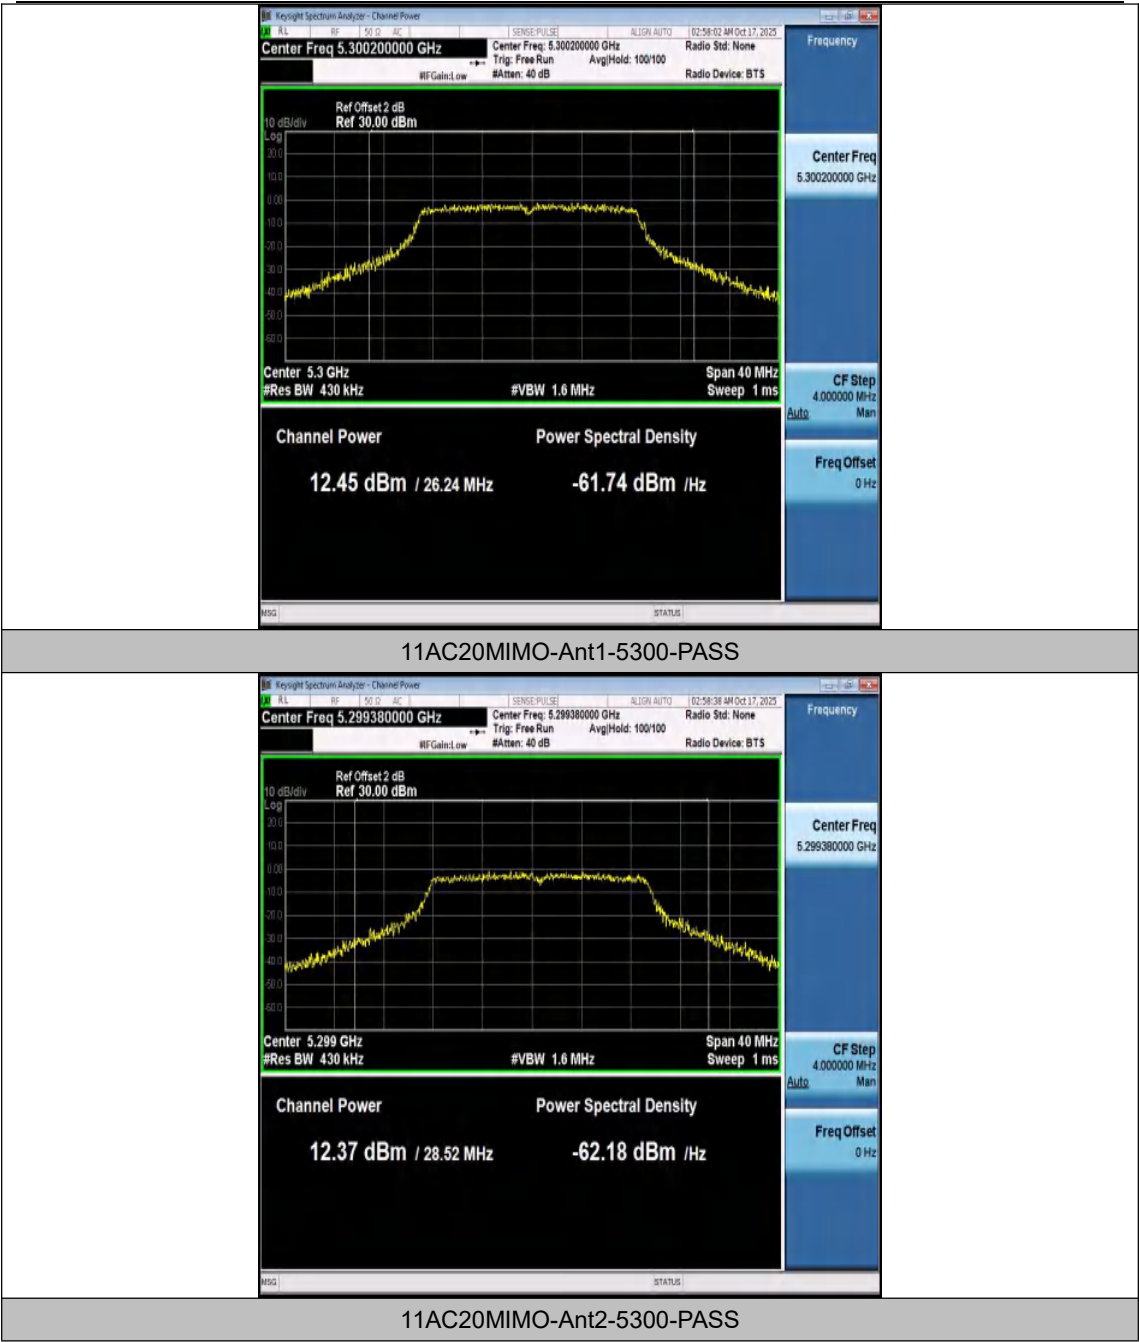

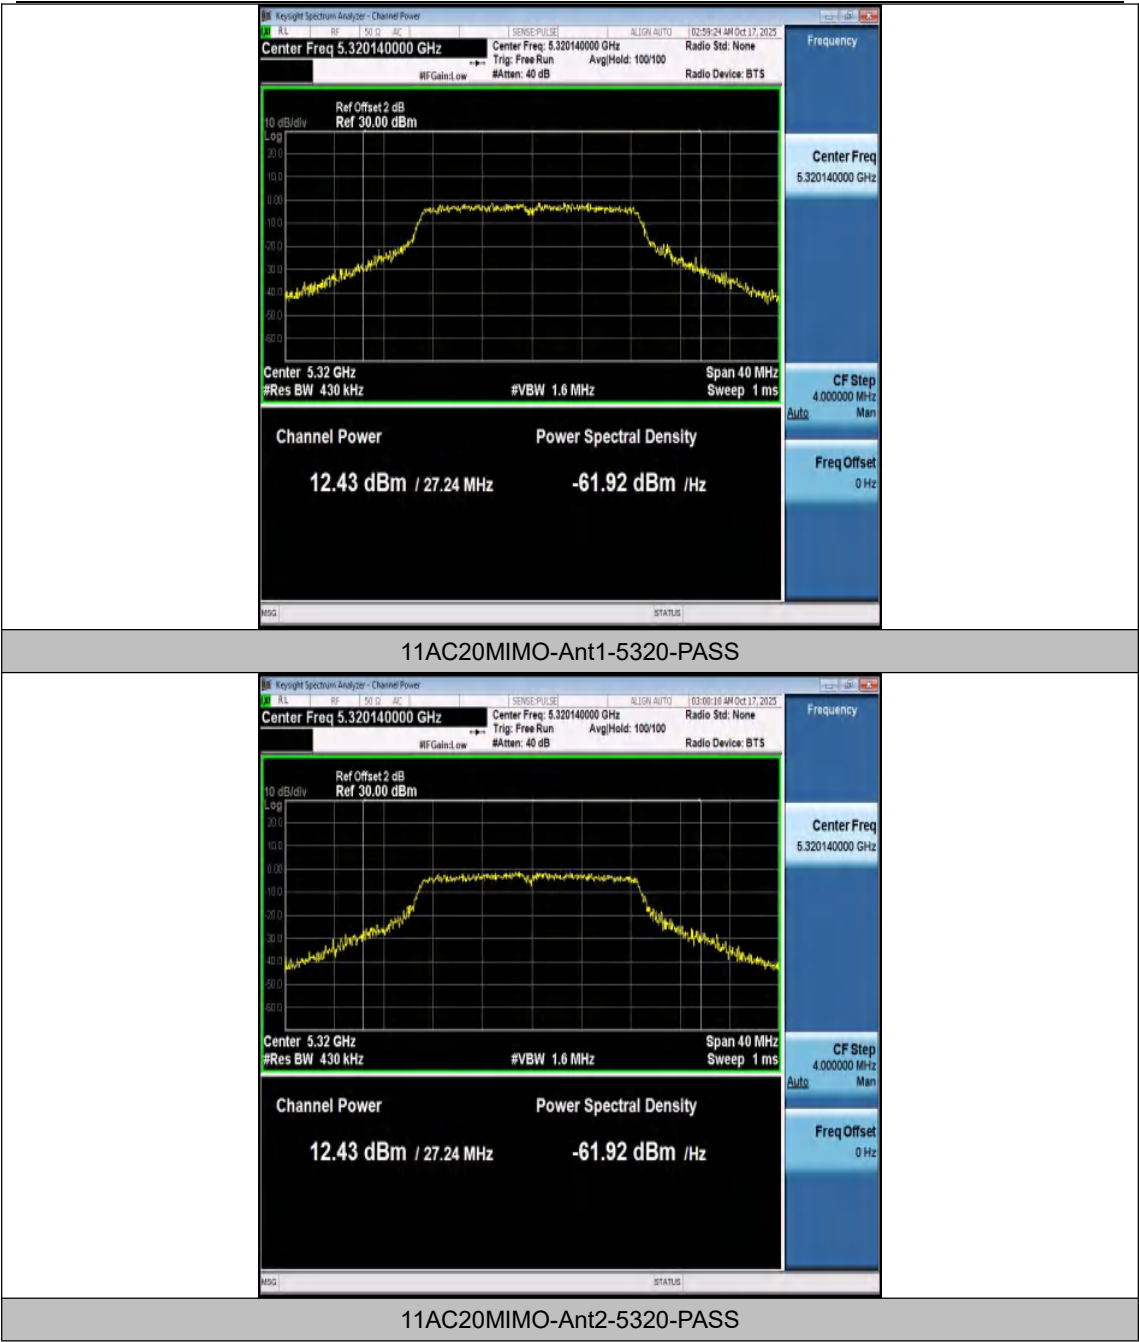

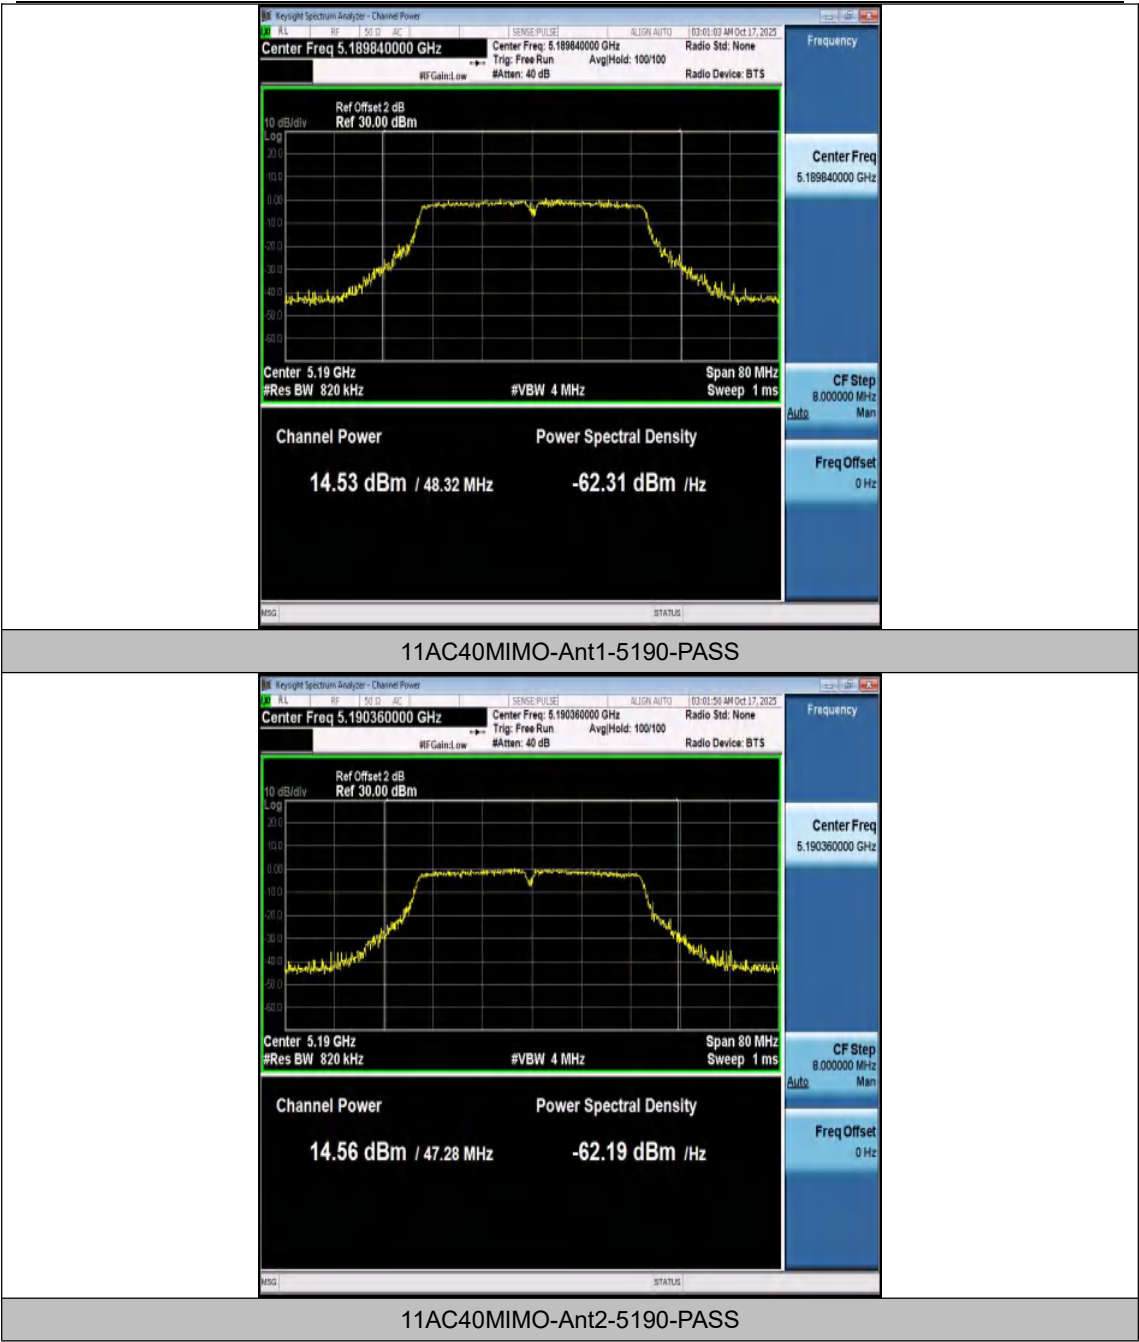

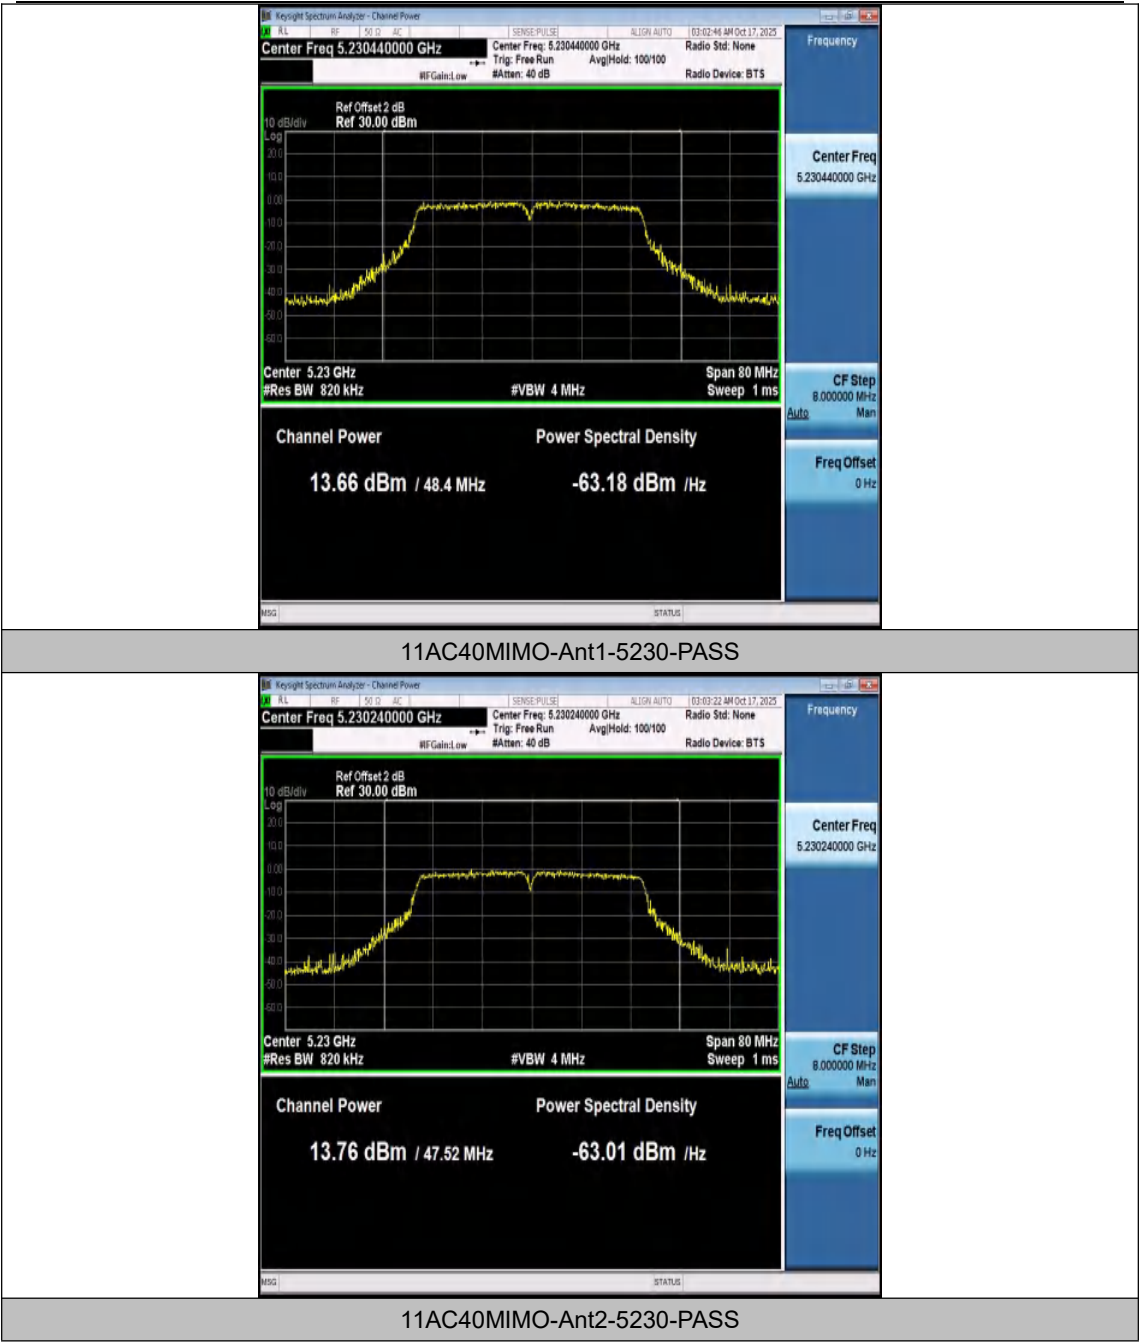


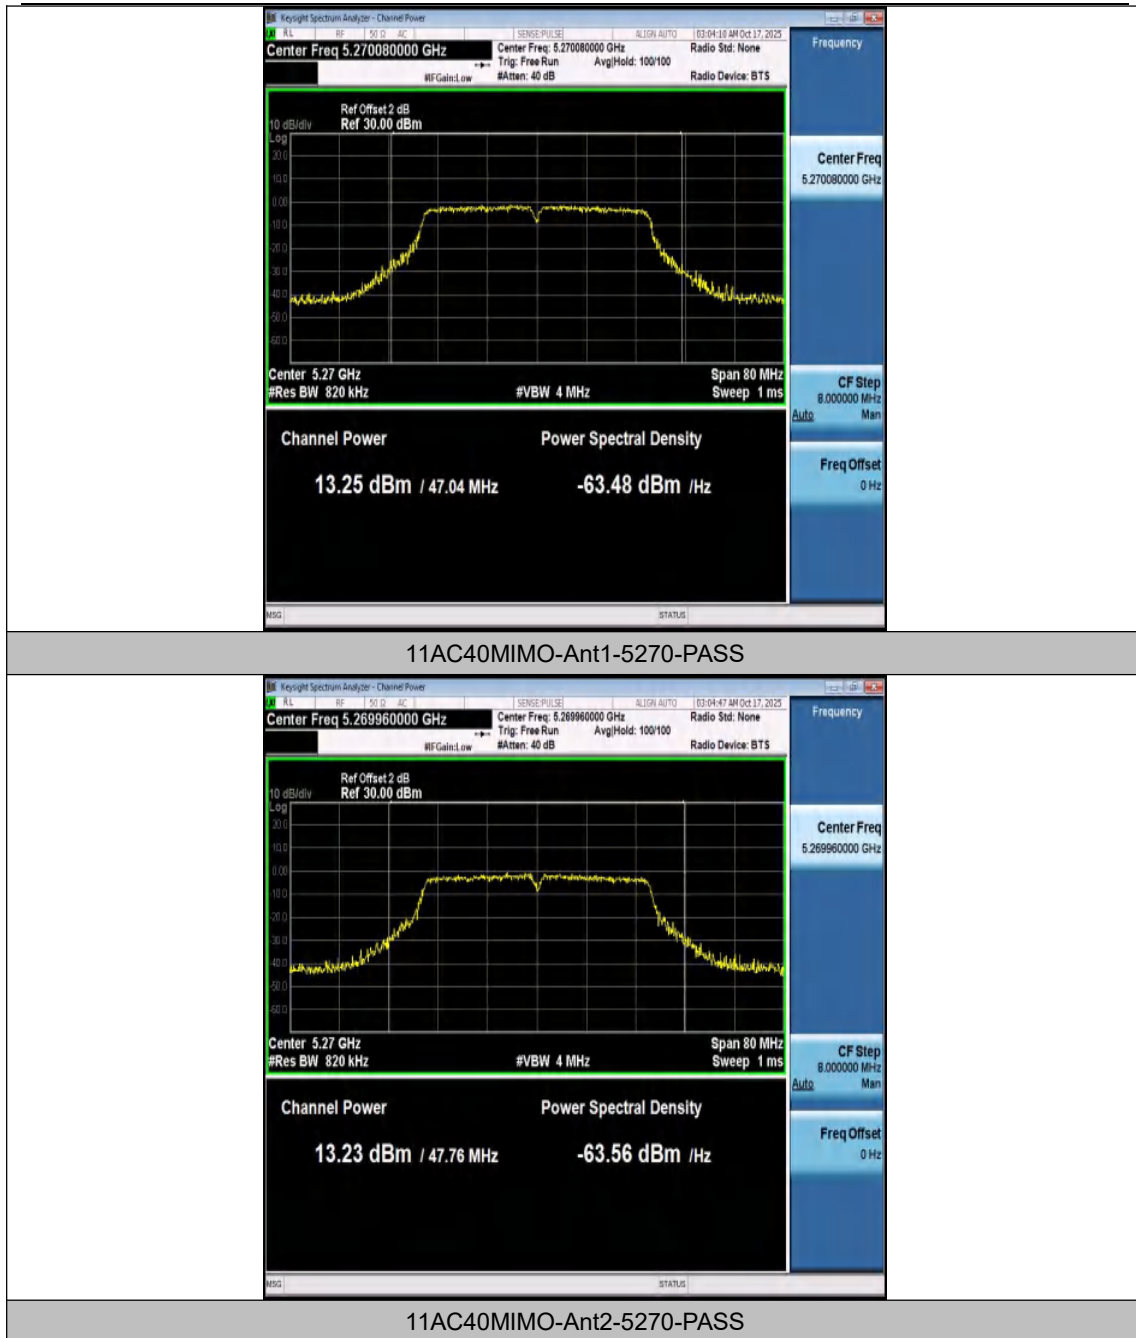



Shenzhen Anbotech Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

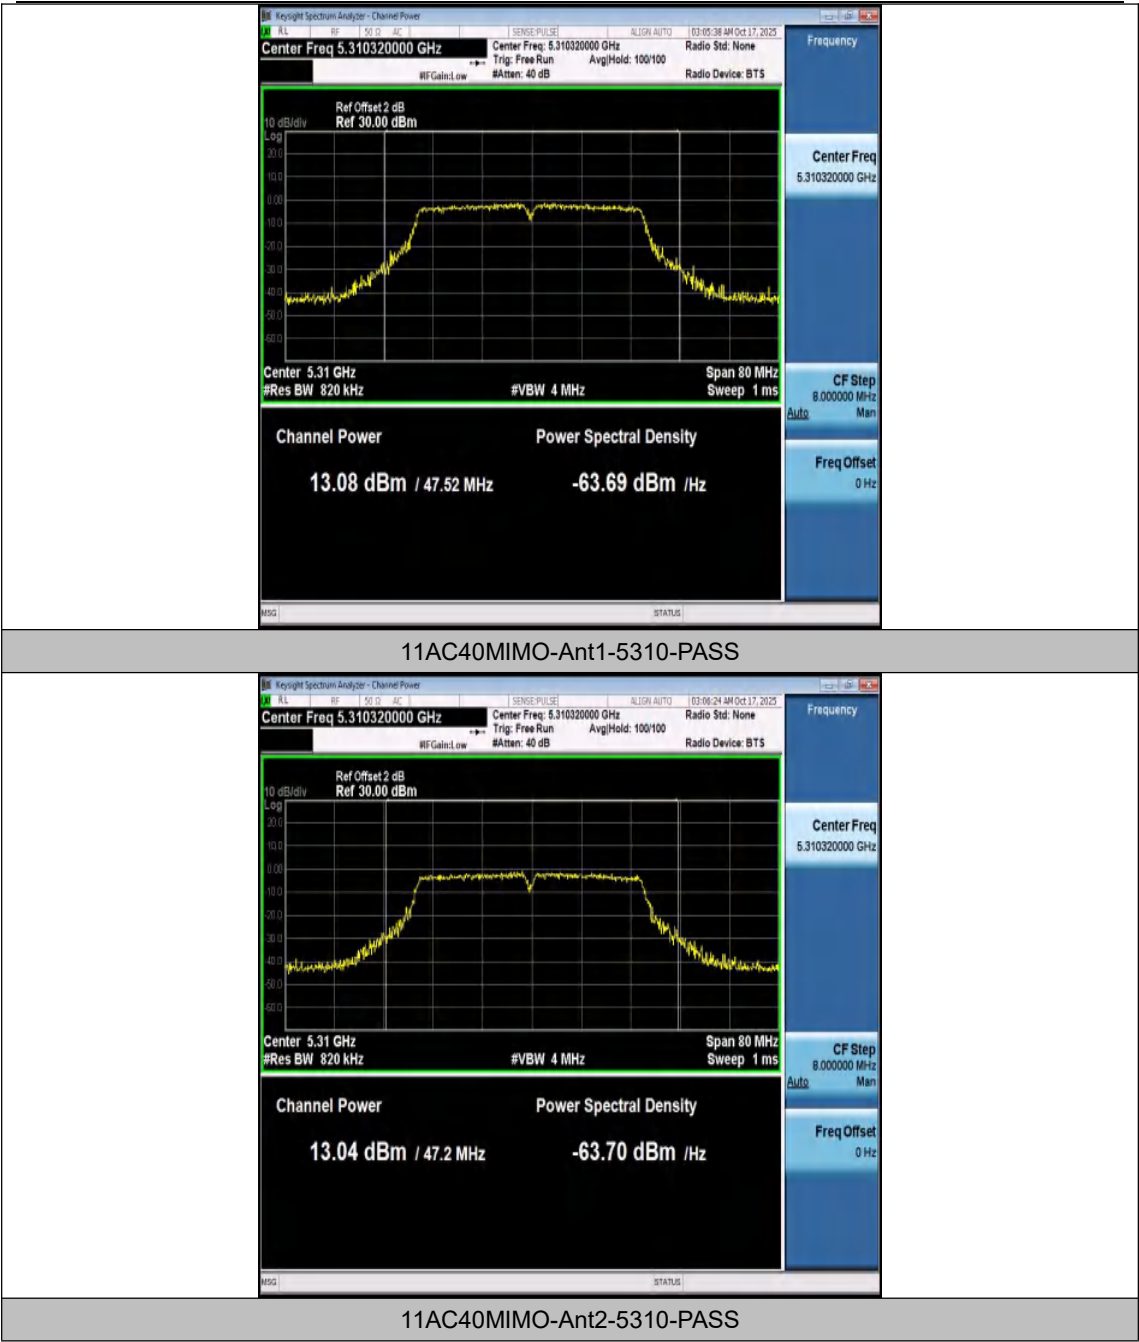


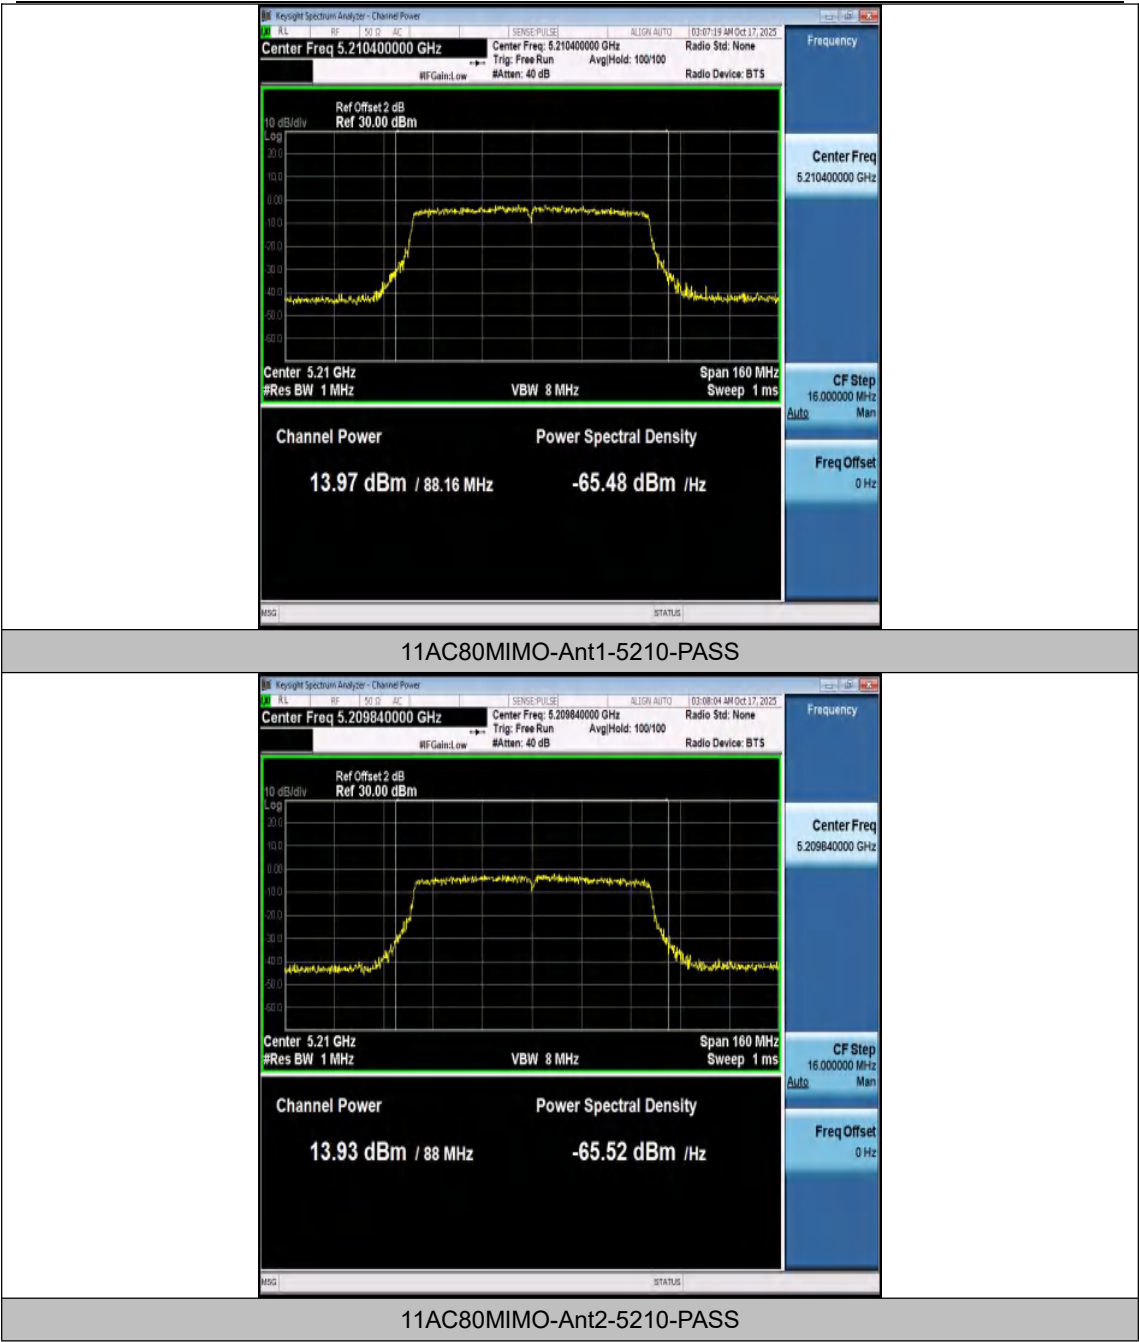


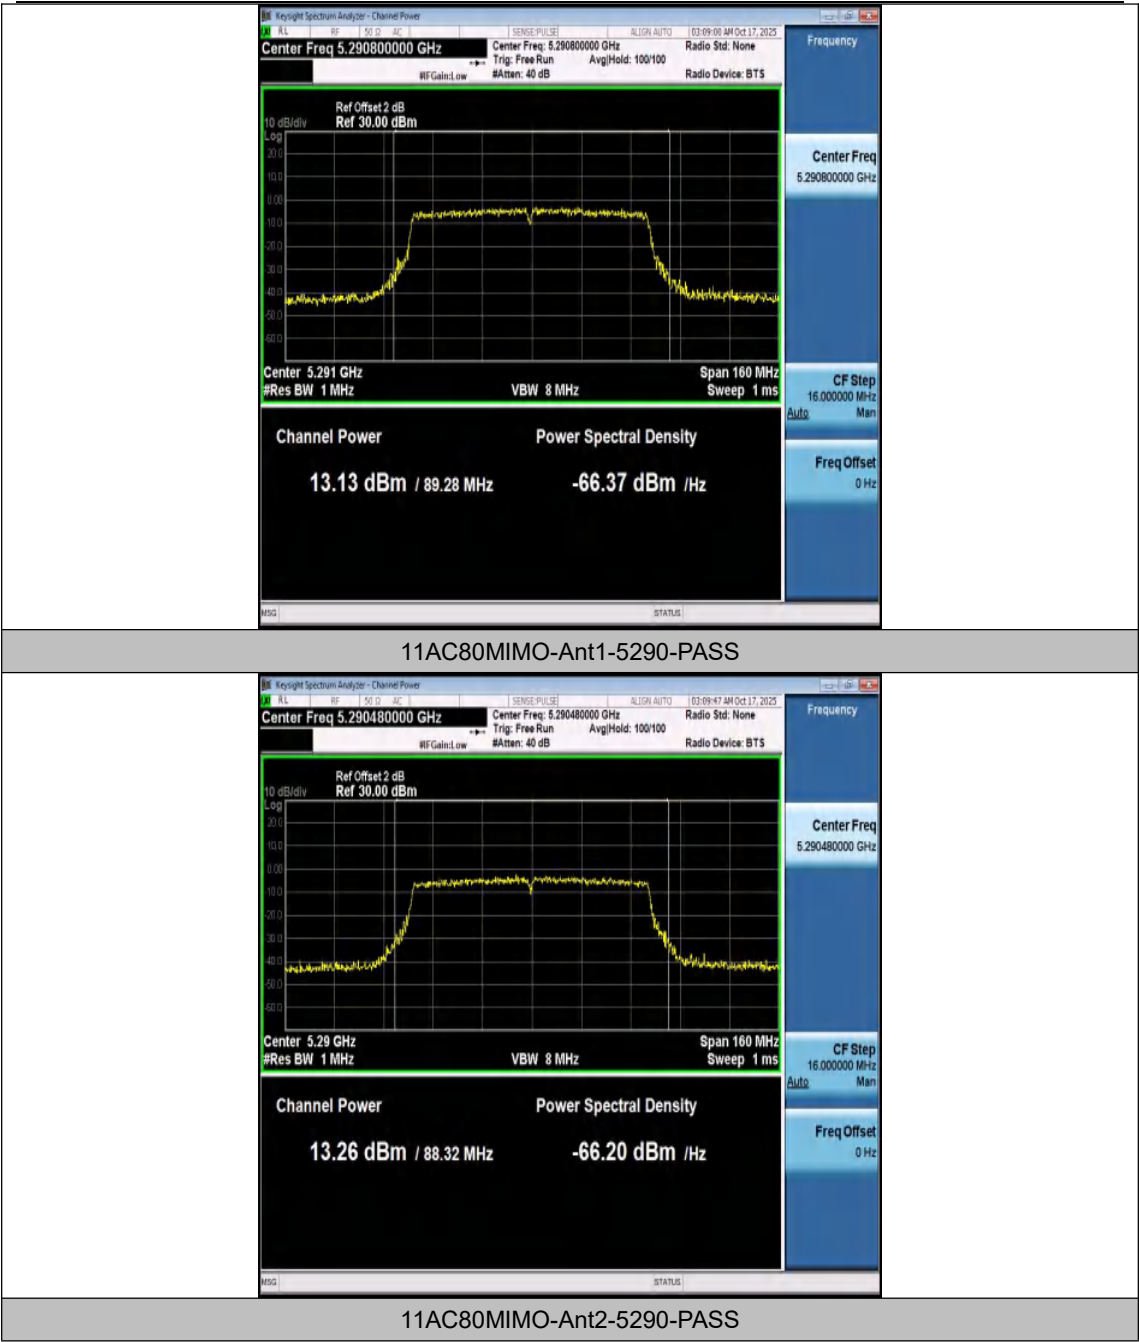


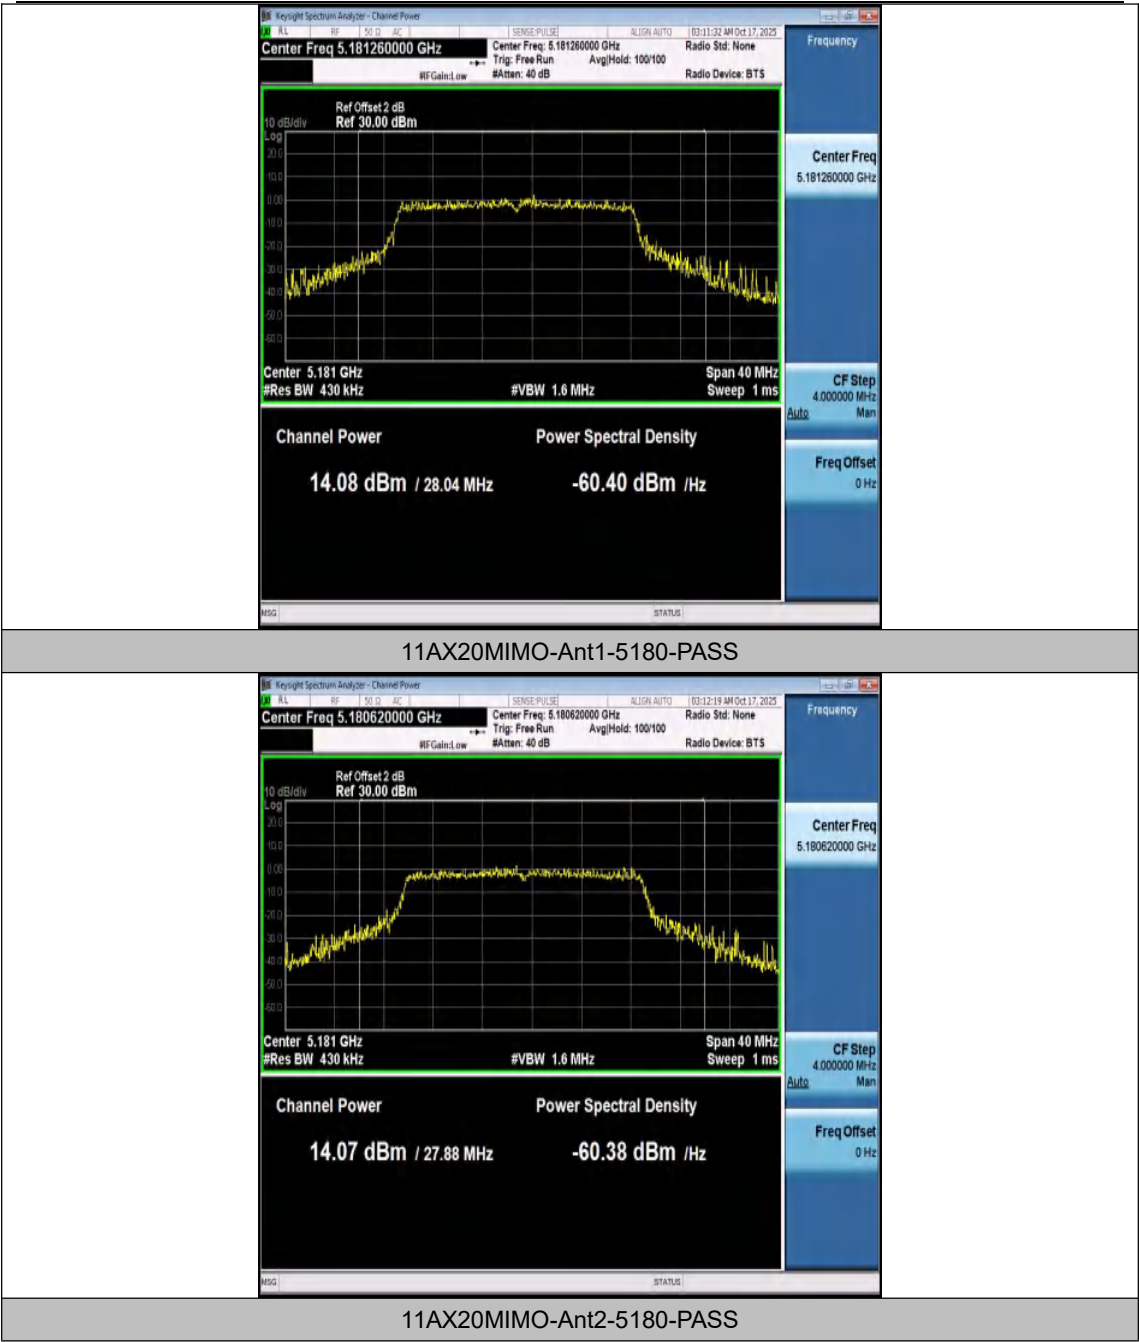

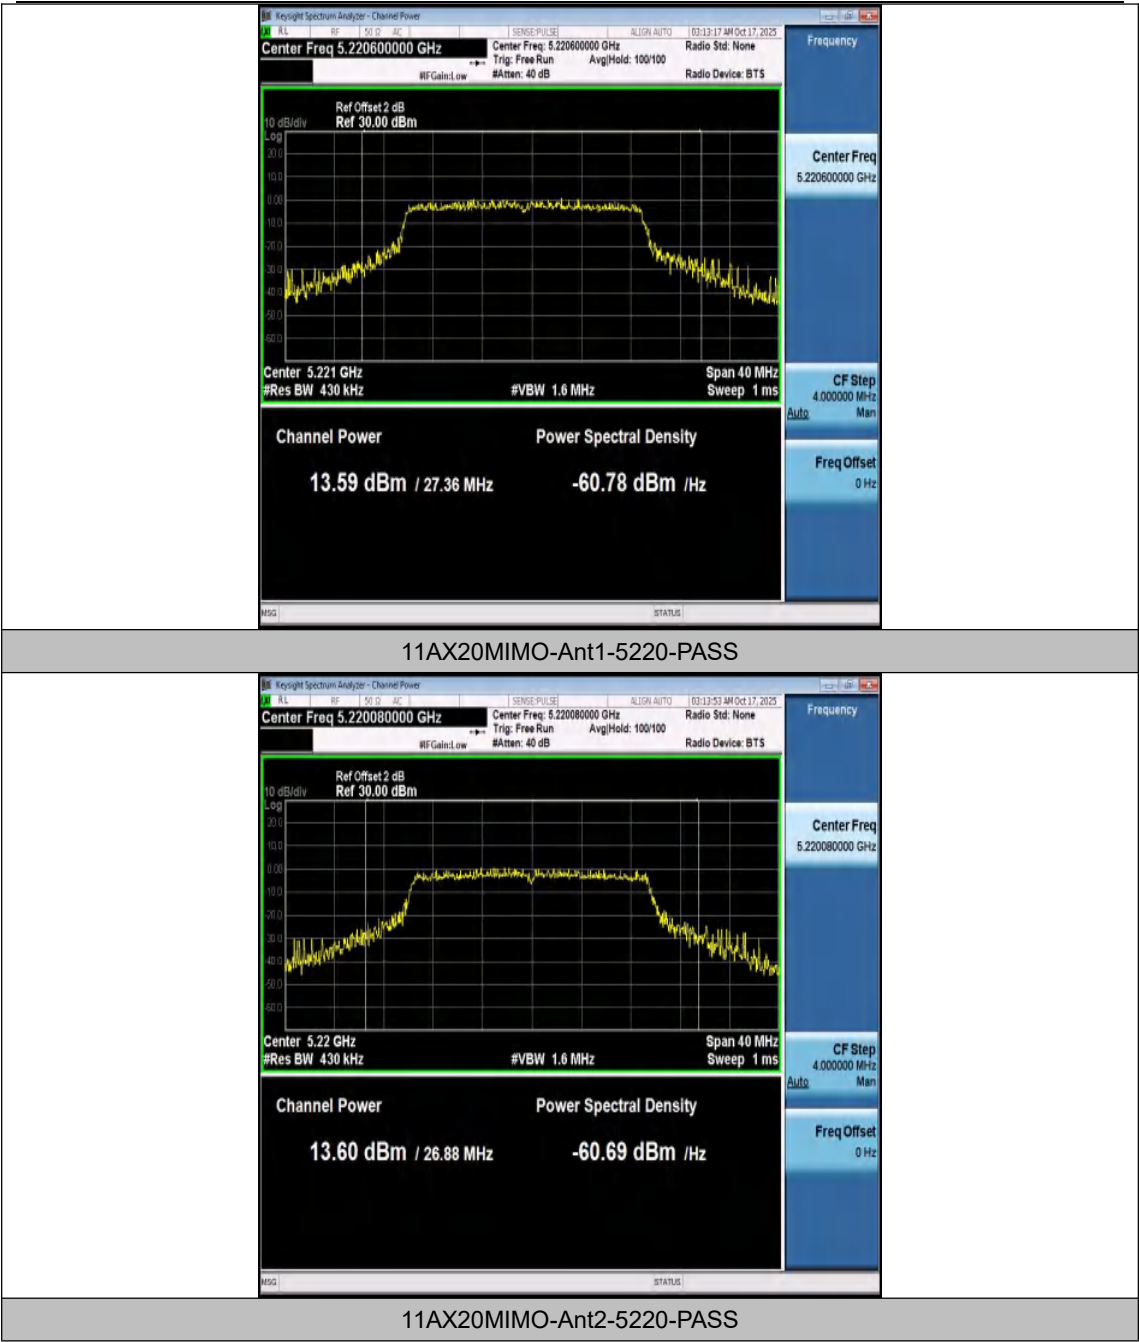

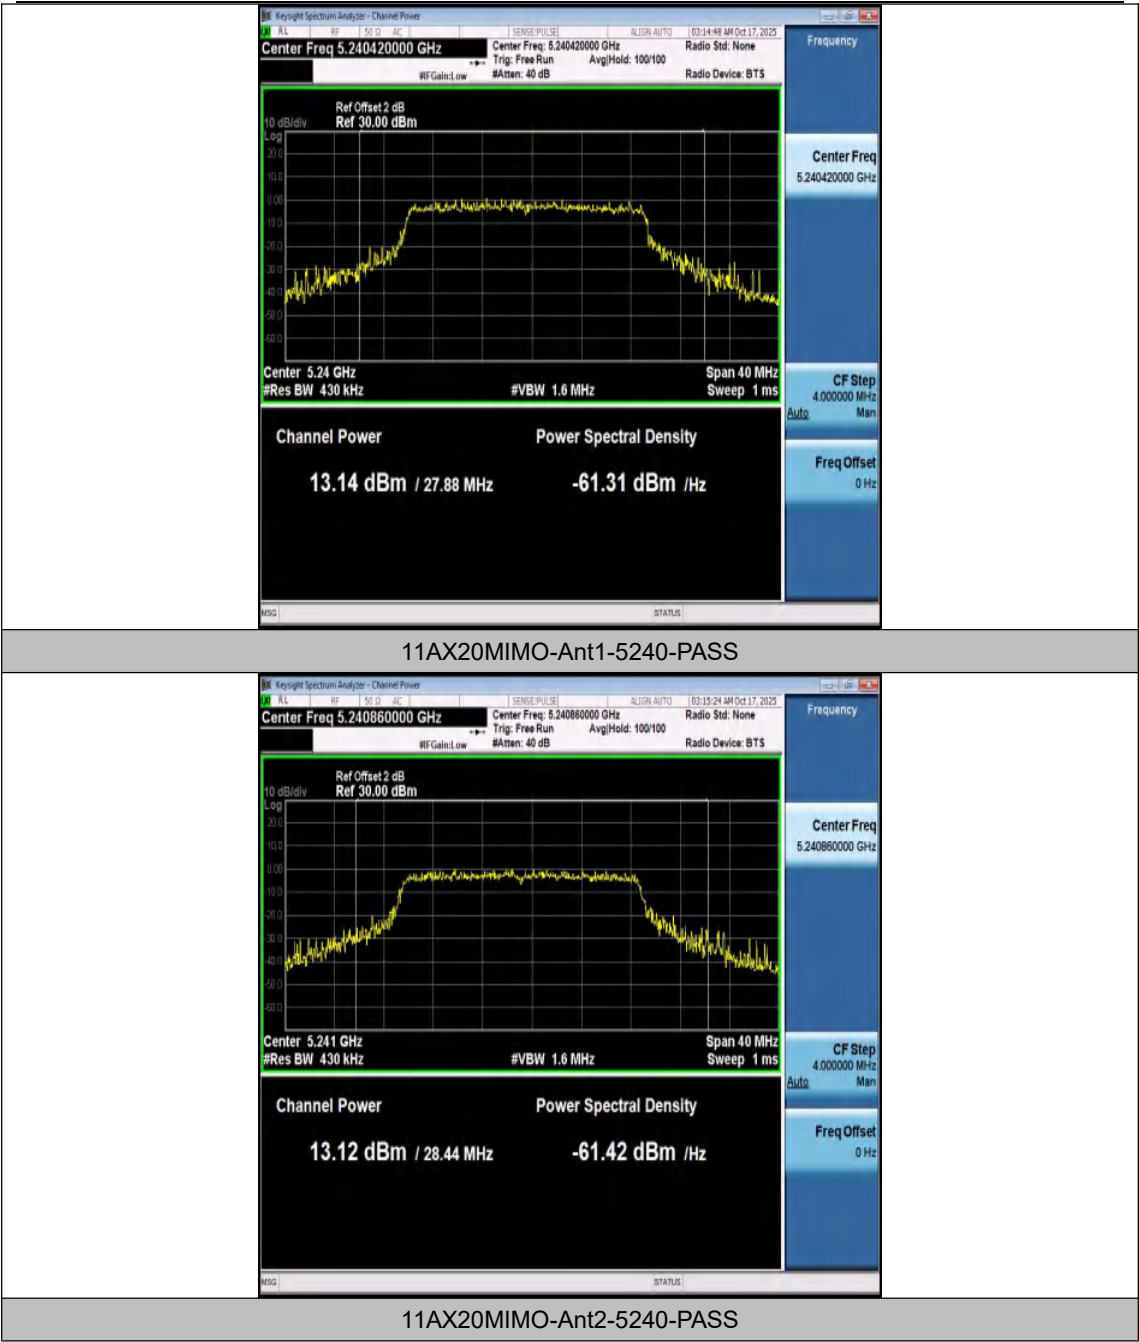

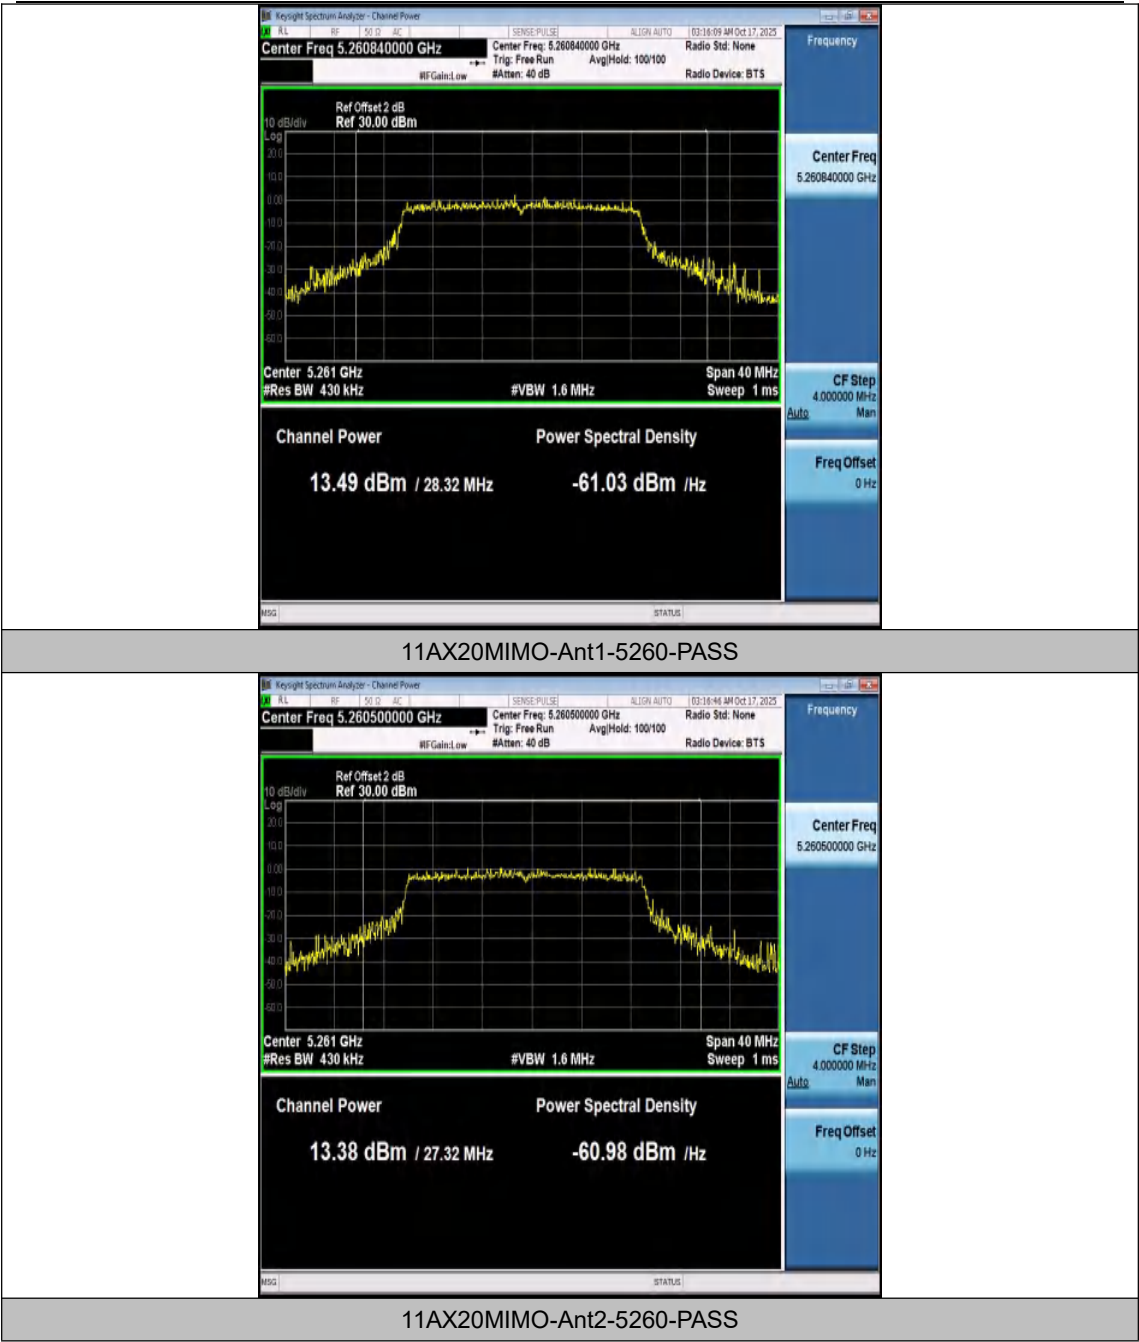


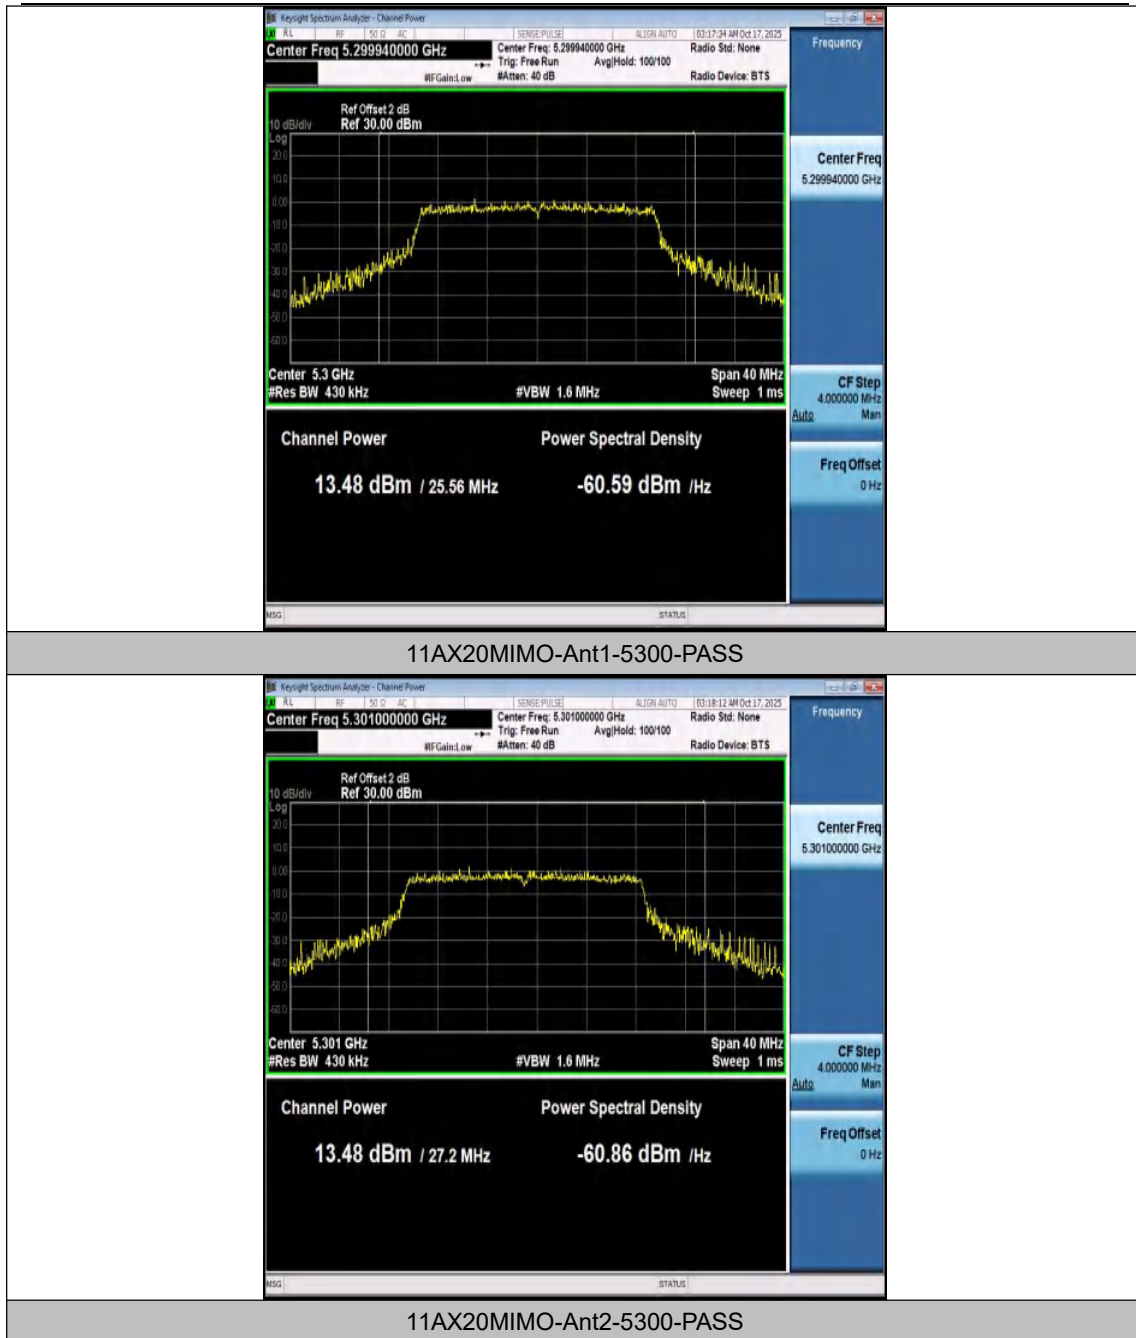



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

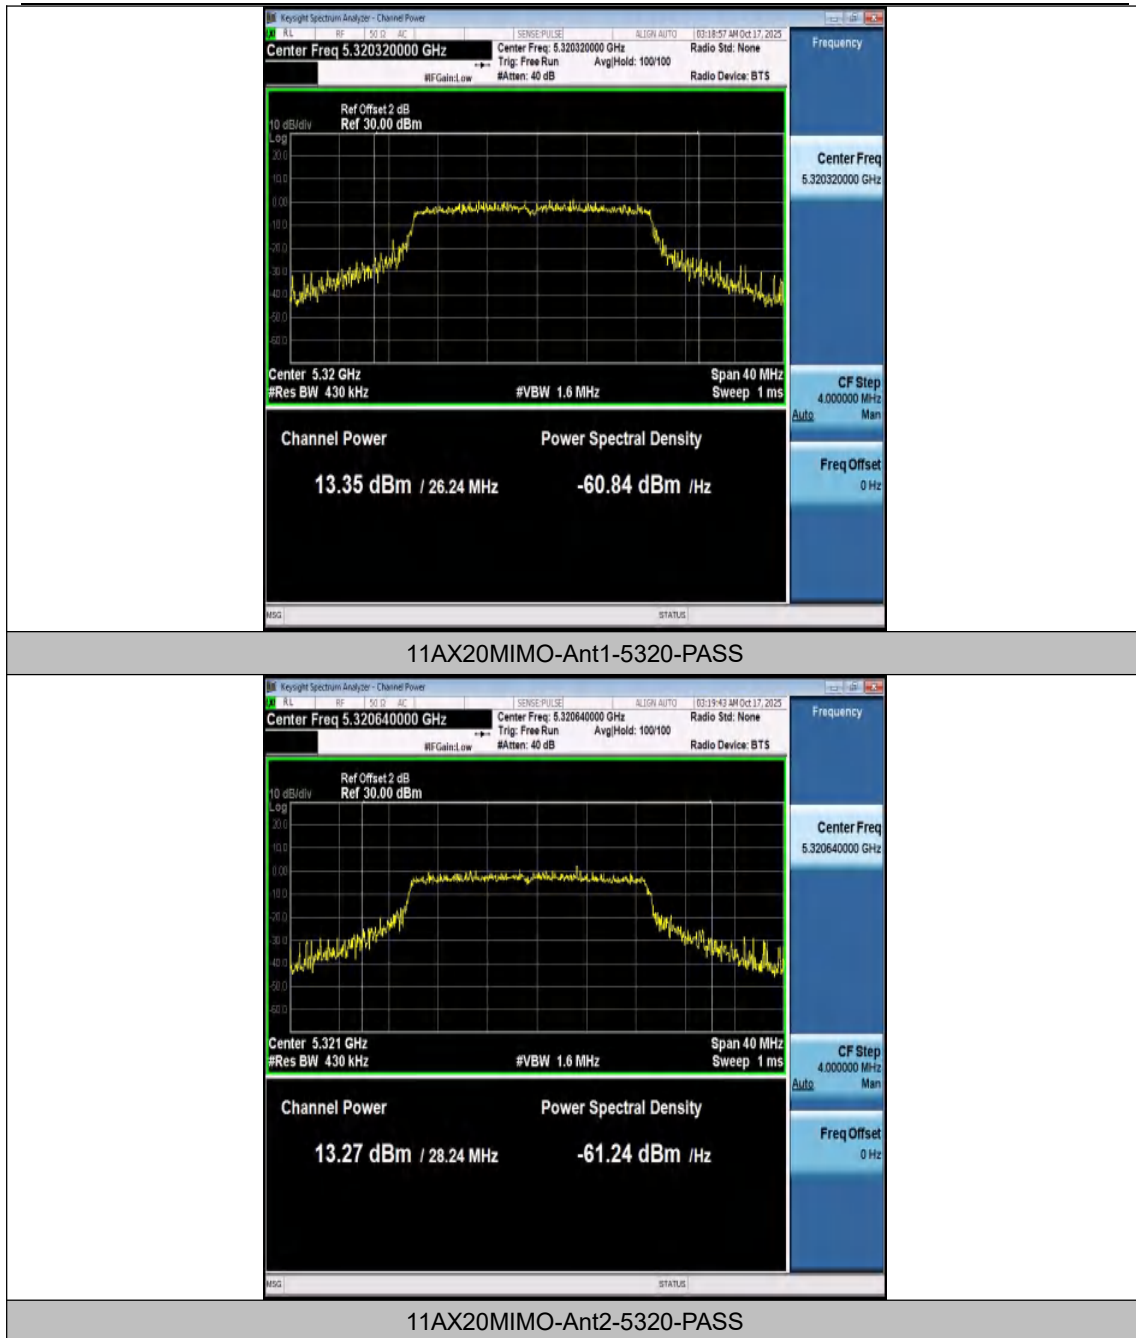

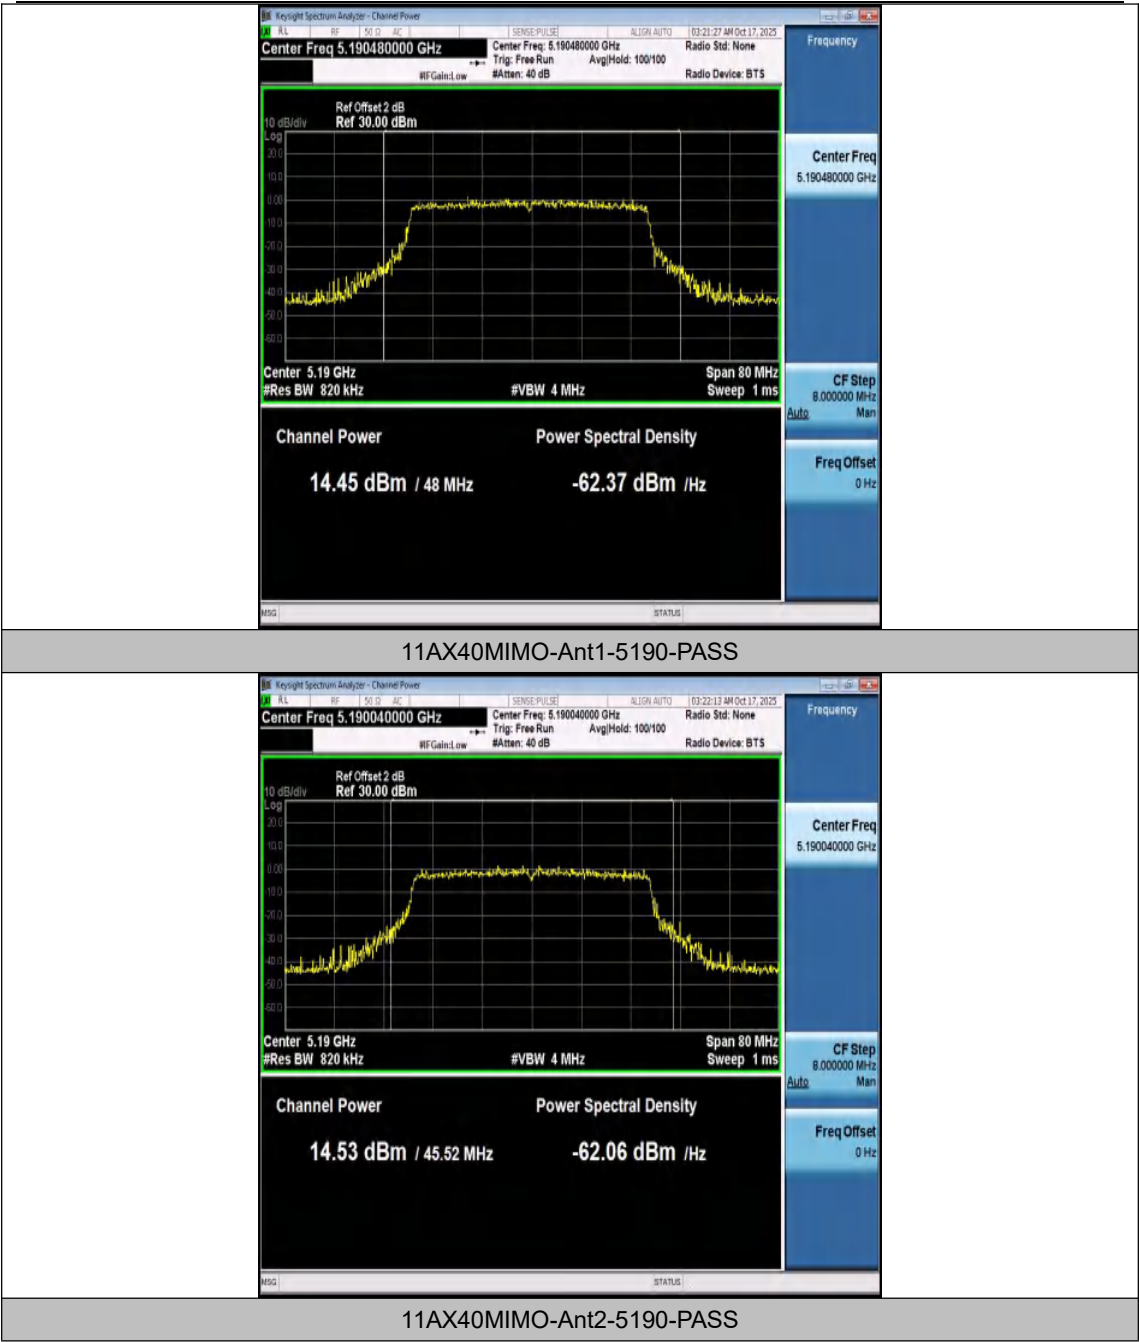

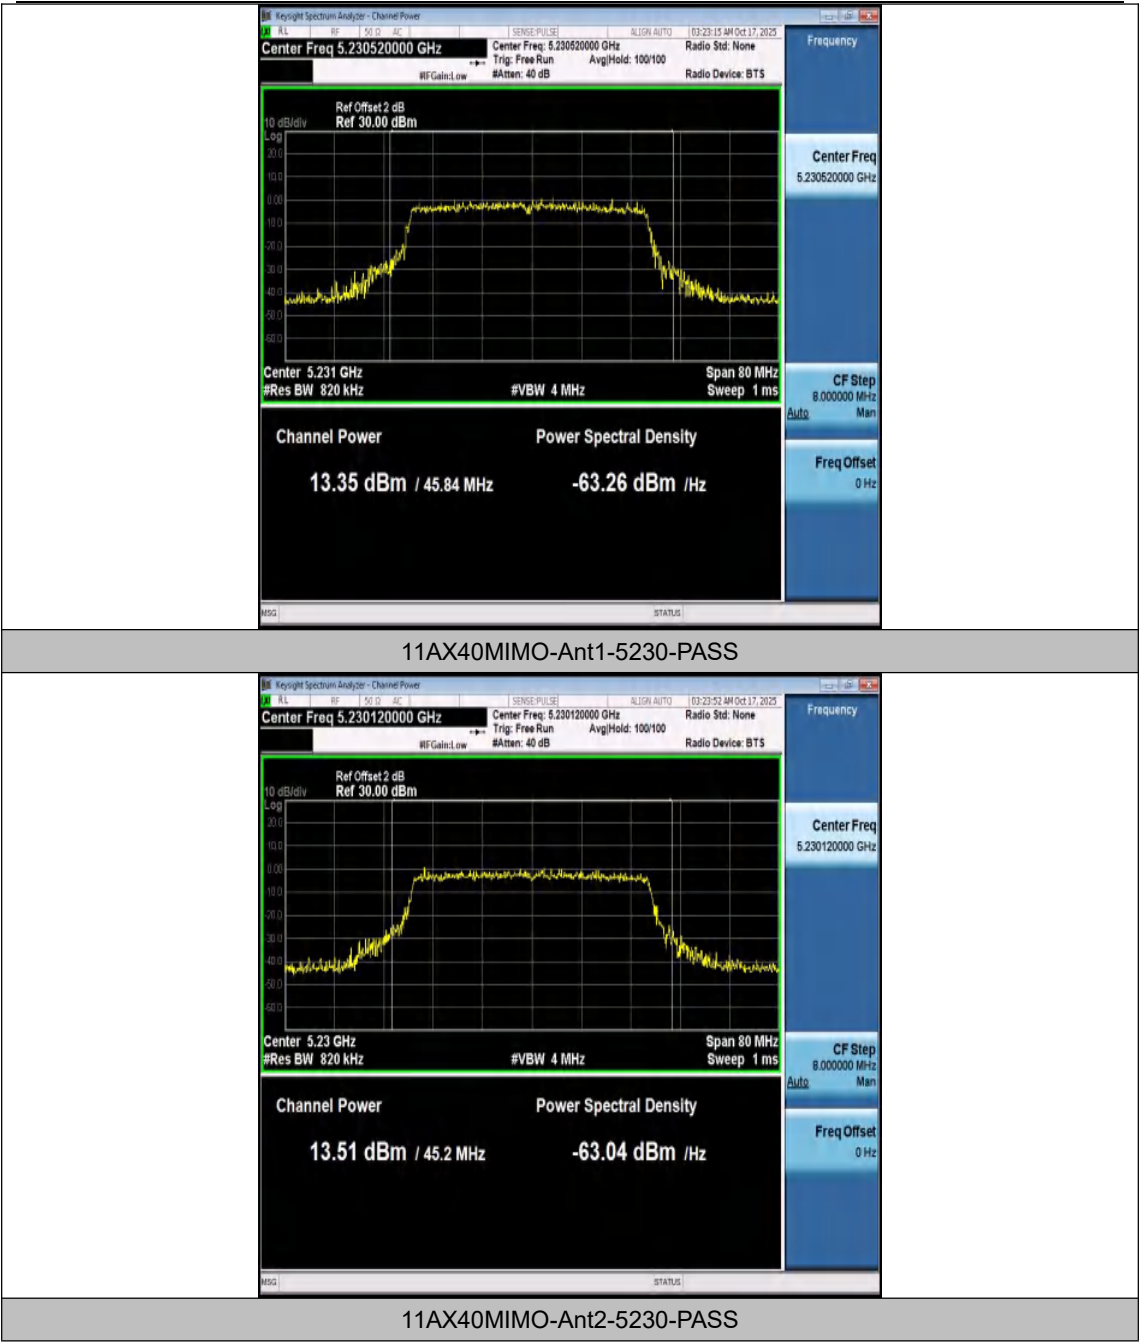


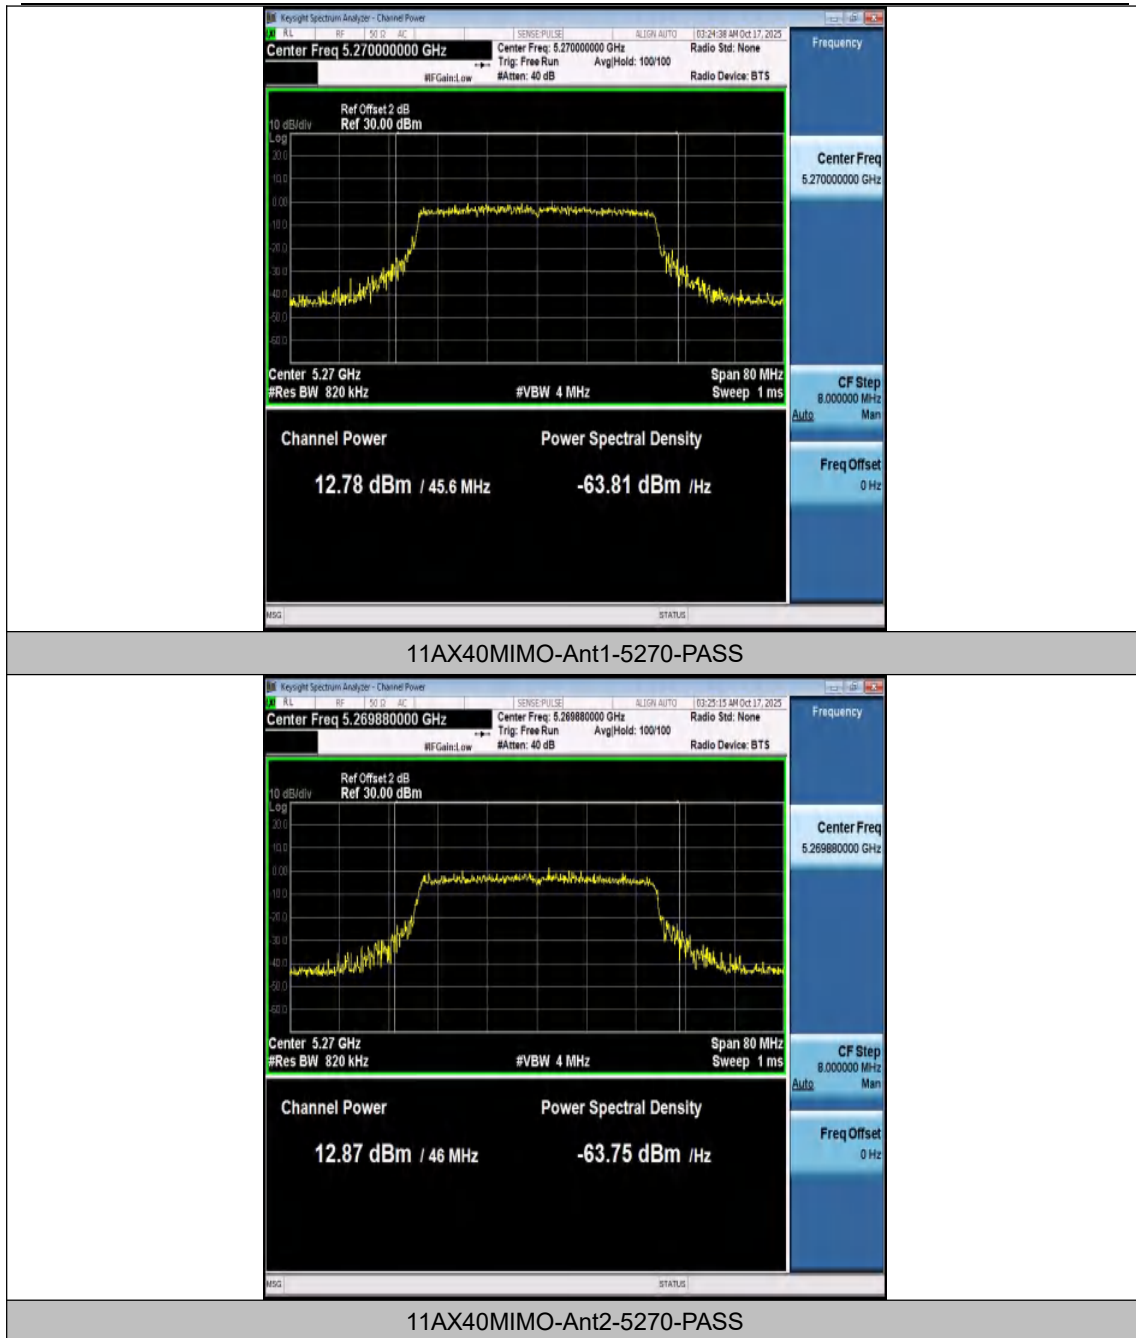


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

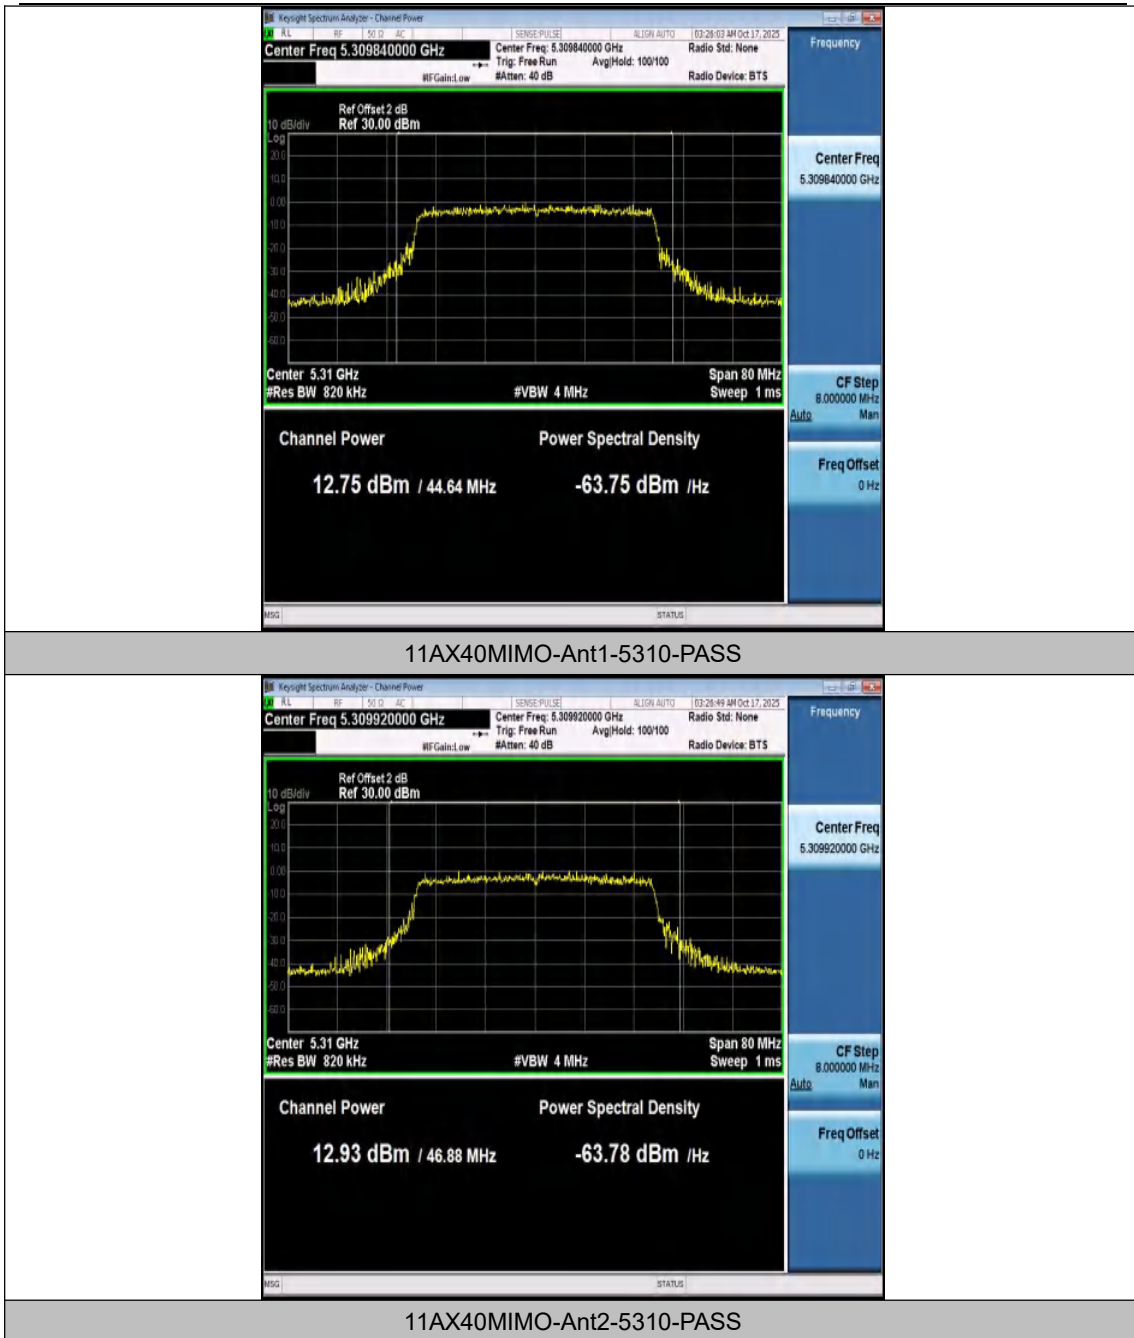


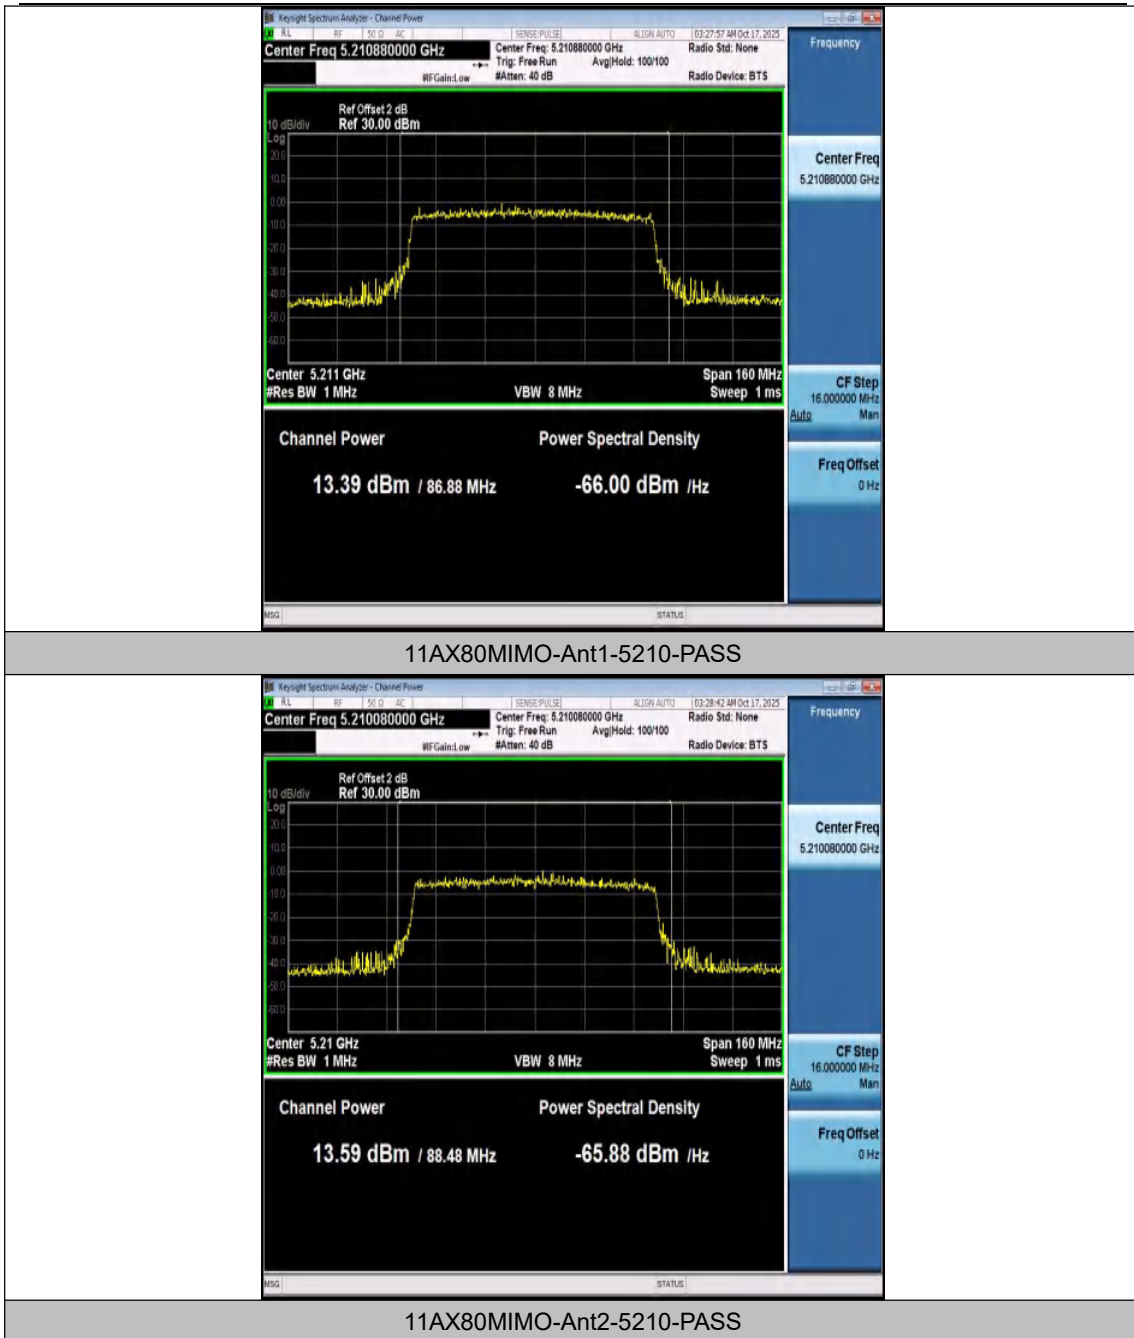

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

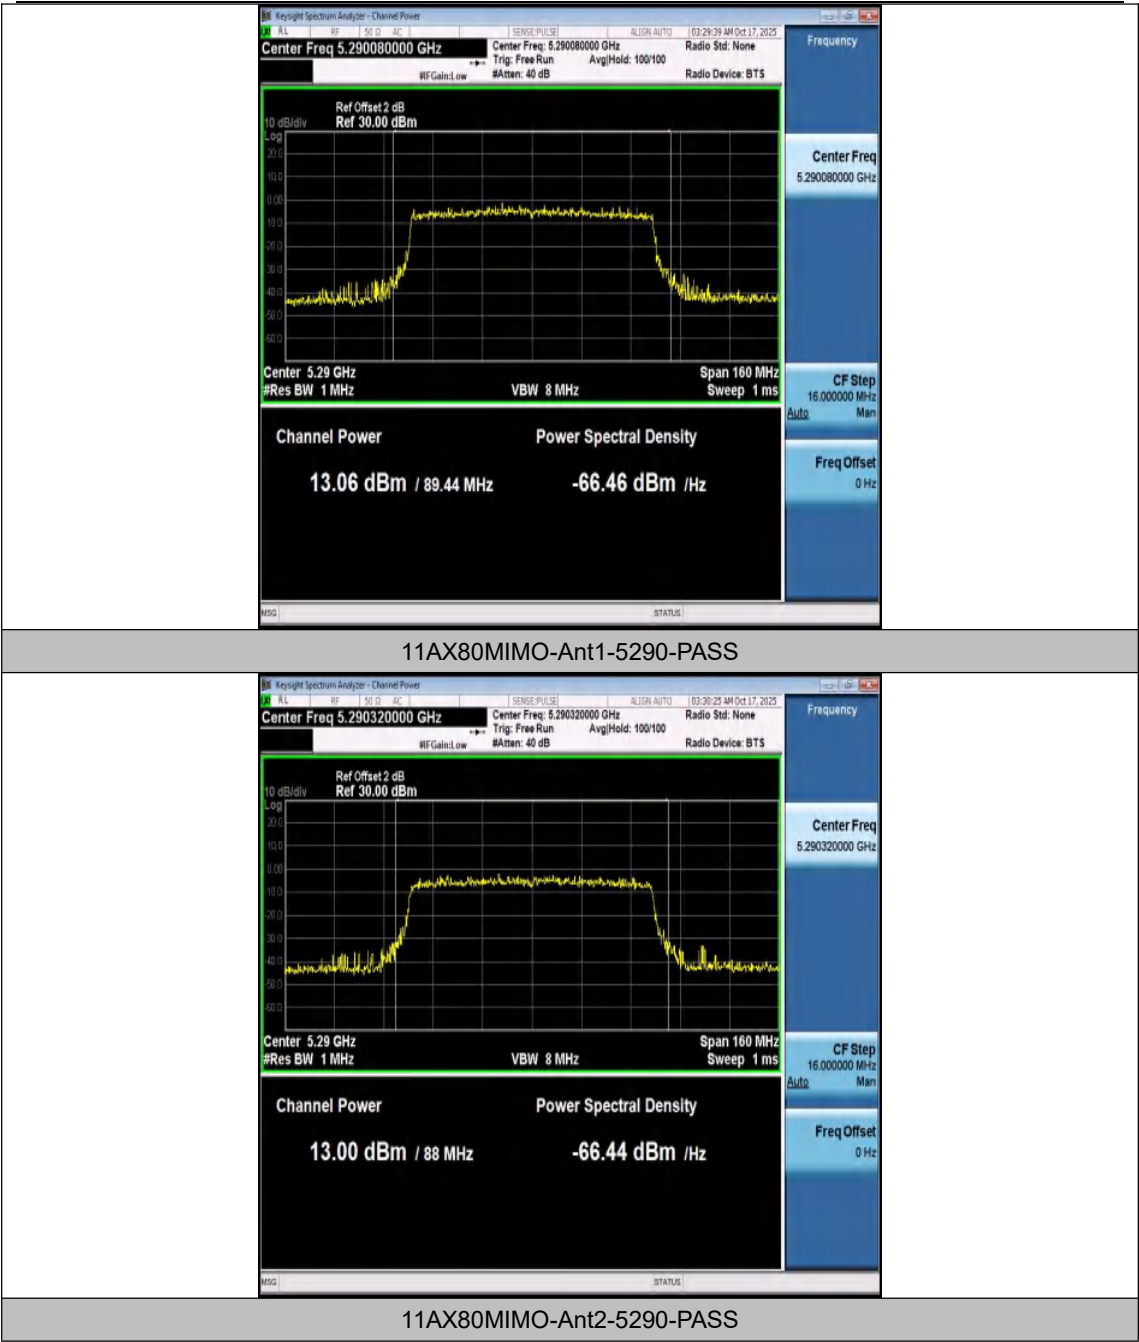

Appendix D: Maximum Power Spectral Density

Test Result B1/2

Test Mode	Antenna	Frequency[MHz]	Result [dBm]	Limit [dBm/MHz]	Verdict
11A	Ant1	5180	-1.61	≤11.00	PASS
11A	Ant2	5180	-1.65	≤11.00	PASS
11A	Ant1	5220	-2.60	≤11.00	PASS
11A	Ant2	5220	-2.29	≤11.00	PASS
11A	Ant1	5240	-3.04	≤11.00	PASS
11A	Ant2	5240	-3.27	≤11.00	PASS
11A	Ant1	5260	-3.34	≤11.00	PASS
11A	Ant2	5260	-3.59	≤11.00	PASS
11A	Ant1	5300	-3.41	≤11.00	PASS
11A	Ant2	5300	-3.71	≤11.00	PASS
11A	Ant1	5320	-3.59	≤11.00	PASS
11A	Ant2	5320	-3.84	≤11.00	PASS
11N20MIMO	Ant1	5180	-2.28	≤10.60	PASS
11N20MIMO	Ant2	5180	-2.16	≤10.60	PASS
11N20MIMO	total	5180	0.79	≤10.60	PASS
11N20MIMO	Ant1	5220	-2.90	≤10.60	PASS
11N20MIMO	Ant2	5220	-2.68	≤10.60	PASS
11N20MIMO	total	5220	0.22	≤10.60	PASS
11N20MIMO	Ant1	5240	-3.21	≤10.60	PASS
11N20MIMO	Ant2	5240	-3.12	≤10.60	PASS
11N20MIMO	total	5240	-0.15	≤10.60	PASS
11N20MIMO	Ant1	5260	-3.56	≤10.60	PASS
11N20MIMO	Ant2	5260	-3.87	≤10.60	PASS
11N20MIMO	total	5260	-0.70	≤10.60	PASS
11N20MIMO	Ant1	5300	-2.95	≤10.60	PASS
11N20MIMO	Ant2	5300	-2.97	≤10.60	PASS
11N20MIMO	total	5300	0.05	≤10.60	PASS
11N20MIMO	Ant1	5320	-3.10	≤10.60	PASS
11N20MIMO	Ant2	5320	-2.83	≤10.60	PASS
11N20MIMO	total	5320	0.05	≤10.60	PASS
11N40MIMO	Ant1	5190	-6.85	≤10.60	PASS
11N40MIMO	Ant2	5190	-7.21	≤10.60	PASS
11N40MIMO	total	5190	-4.02	≤10.60	PASS
11N40MIMO	Ant1	5230	-10.17	≤10.60	PASS
11N40MIMO	Ant2	5230	-10.76	≤10.60	PASS
11N40MIMO	total	5230	-7.44	≤10.60	PASS
11N40MIMO	Ant1	5270	-7.48	≤10.60	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11N40MIMO	Ant2	5270	-7.94	≤10.60	PASS
11N40MIMO	total	5270	-4.69	≤10.60	PASS
11N40MIMO	Ant1	5310	-8.74	≤10.60	PASS
11N40MIMO	Ant2	5310	-8.56	≤10.60	PASS
11N40MIMO	total	5310	-5.64	≤10.60	PASS
11AC20MIMO	Ant1	5180	-1.88	≤10.60	PASS
11AC20MIMO	Ant2	5180	-2.05	≤10.60	PASS
11AC20MIMO	total	5180	1.05	≤10.60	PASS
11AC20MIMO	Ant1	5220	-2.94	≤10.60	PASS
11AC20MIMO	Ant2	5220	-2.75	≤10.60	PASS
11AC20MIMO	total	5220	0.17	≤10.60	PASS
11AC20MIMO	Ant1	5240	-3.34	≤10.60	PASS
11AC20MIMO	Ant2	5240	-3.24	≤10.60	PASS
11AC20MIMO	total	5240	-0.28	≤10.60	PASS
11AC20MIMO	Ant1	5260	-3.47	≤10.60	PASS
11AC20MIMO	Ant2	5260	-3.62	≤10.60	PASS
11AC20MIMO	total	5260	-0.53	≤10.60	PASS
11AC20MIMO	Ant1	5300	-4.27	≤10.60	PASS
11AC20MIMO	Ant2	5300	-4.09	≤10.60	PASS
11AC20MIMO	total	5300	-1.17	≤10.60	PASS
11AC20MIMO	Ant1	5320	-3.93	≤10.60	PASS
11AC20MIMO	Ant2	5320	-3.95	≤10.60	PASS
11AC20MIMO	total	5320	-0.93	≤10.60	PASS
11AC40MIMO	Ant1	5190	-4.59	≤10.60	PASS
11AC40MIMO	Ant2	5190	-4.52	≤10.60	PASS
11AC40MIMO	total	5190	-1.54	≤10.60	PASS
11AC40MIMO	Ant1	5230	-5.56	≤10.60	PASS
11AC40MIMO	Ant2	5230	-5.88	≤10.60	PASS
11AC40MIMO	total	5230	-2.71	≤10.60	PASS
11AC40MIMO	Ant1	5270	-6.36	≤10.60	PASS
11AC40MIMO	Ant2	5270	-6.10	≤10.60	PASS
11AC40MIMO	total	5270	-3.22	≤10.60	PASS
11AC40MIMO	Ant1	5310	-6.61	≤10.60	PASS
11AC40MIMO	Ant2	5310	-7.18	≤10.60	PASS
11AC40MIMO	total	5310	-3.88	≤10.60	PASS
11AC80MIMO	Ant1	5210	-8.81	≤10.60	PASS
11AC80MIMO	Ant2	5210	-9.13	≤10.60	PASS
11AC80MIMO	total	5210	-5.96	≤10.60	PASS
11AC80MIMO	Ant1	5290	-10.80	≤10.60	PASS
11AC80MIMO	Ant2	5290	-10.59	≤10.60	PASS
11AC80MIMO	total	5290	-7.68	≤10.60	PASS
11AX20MIMO	Ant1	5180	-3.81	≤10.60	PASS

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX20MIMO	Ant2	5180	-3.38	≤10.60	PASS
11AX20MIMO	total	5180	-0.58	≤10.60	PASS
11AX20MIMO	Ant1	5220	-4.08	≤10.60	PASS
11AX20MIMO	Ant2	5220	-4.04	≤10.60	PASS
11AX20MIMO	total	5220	-1.05	≤10.60	PASS
11AX20MIMO	Ant1	5240	-4.19	≤10.60	PASS
11AX20MIMO	Ant2	5240	-4.38	≤10.60	PASS
11AX20MIMO	total	5240	-1.27	≤10.60	PASS
11AX20MIMO	Ant1	5260	-4.24	≤10.60	PASS
11AX20MIMO	Ant2	5260	-3.98	≤10.60	PASS
11AX20MIMO	total	5260	-1.10	≤10.60	PASS
11AX20MIMO	Ant1	5300	-4.29	≤10.60	PASS
11AX20MIMO	Ant2	5300	-4.12	≤10.60	PASS
11AX20MIMO	total	5300	-1.19	≤10.60	PASS
11AX20MIMO	Ant1	5320	-4.11	≤10.60	PASS
11AX20MIMO	Ant2	5320	-4.31	≤10.60	PASS
11AX20MIMO	total	5320	-1.20	≤10.60	PASS
11AX40MIMO	Ant1	5190	-5.64	≤10.60	PASS
11AX40MIMO	Ant2	5190	-5.83	≤10.60	PASS
11AX40MIMO	total	5190	-2.72	≤10.60	PASS
11AX40MIMO	Ant1	5230	-7.07	≤10.60	PASS
11AX40MIMO	Ant2	5230	-8.45	≤10.60	PASS
11AX40MIMO	total	5230	-4.70	≤10.60	PASS
11AX40MIMO	Ant1	5270	-7.36	≤10.60	PASS
11AX40MIMO	Ant2	5270	-7.54	≤10.60	PASS
11AX40MIMO	total	5270	-4.44	≤10.60	PASS
11AX40MIMO	Ant1	5310	-7.61	≤10.60	PASS
11AX40MIMO	Ant2	5310	-7.85	≤10.60	PASS
11AX40MIMO	total	5310	-4.72	≤10.60	PASS
11AX80MIMO	Ant1	5210	-11.38	≤10.60	PASS
11AX80MIMO	Ant2	5210	-10.27	≤10.60	PASS
11AX80MIMO	total	5210	-7.78	≤10.60	PASS
11AX80MIMO	Ant1	5290	-10.72	≤10.60	PASS
11AX80MIMO	Ant2	5290	-10.23	≤10.60	PASS
11AX80MIMO	total	5290	-7.46	≤10.60	PASS

Note: 1.The cable loss are compensated in the graph.


Test Graphs B1/2

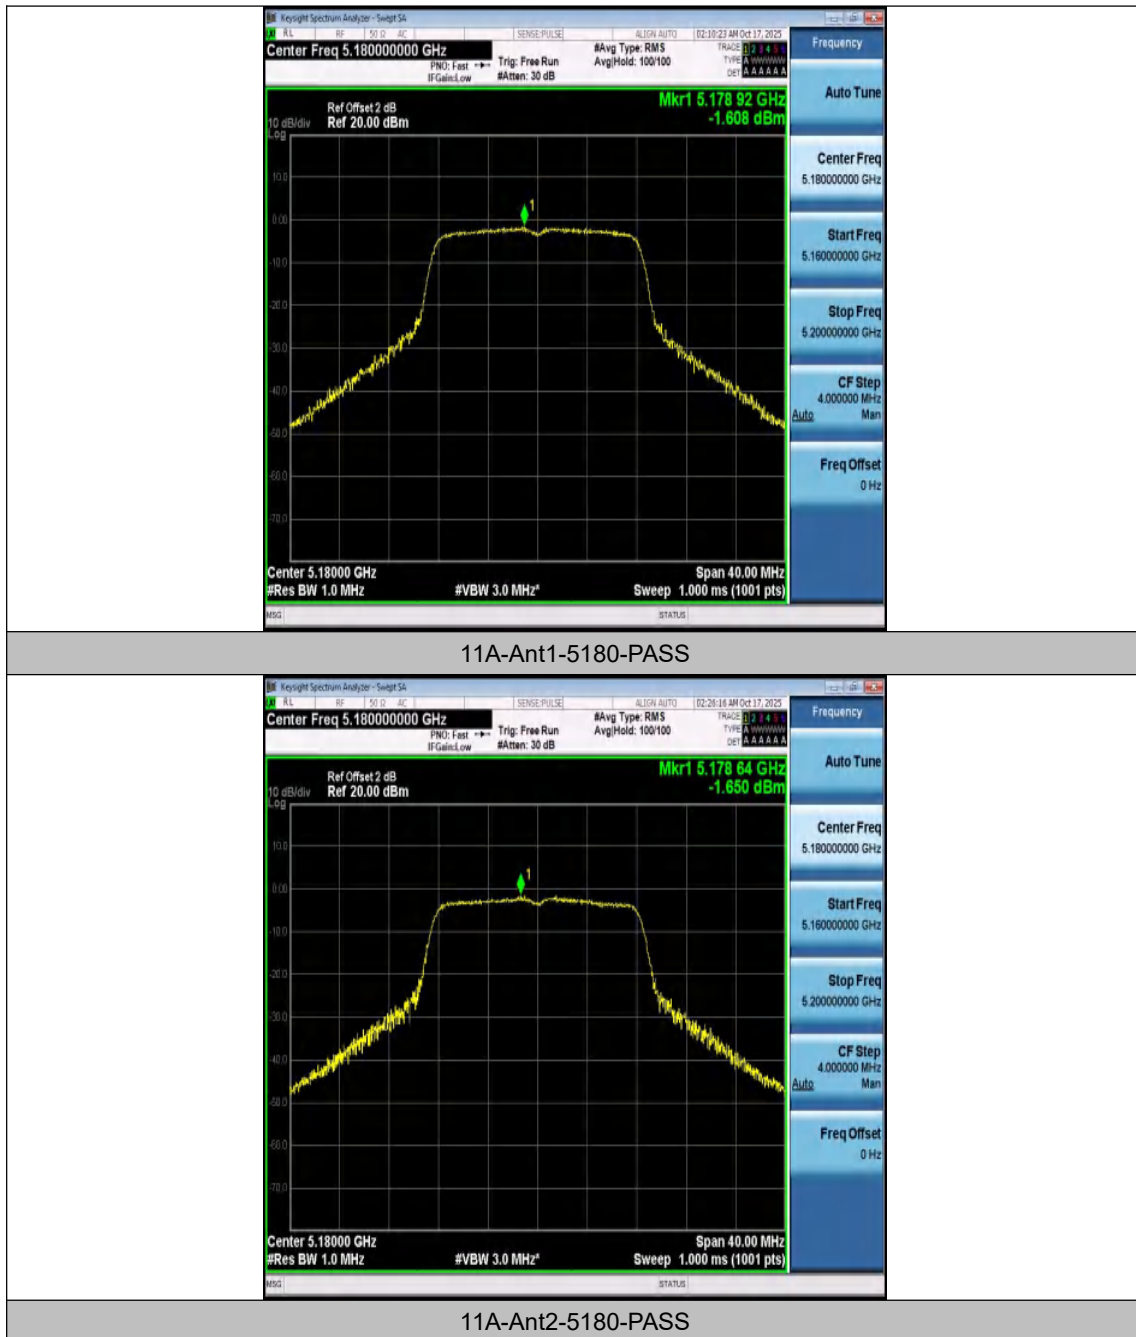

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

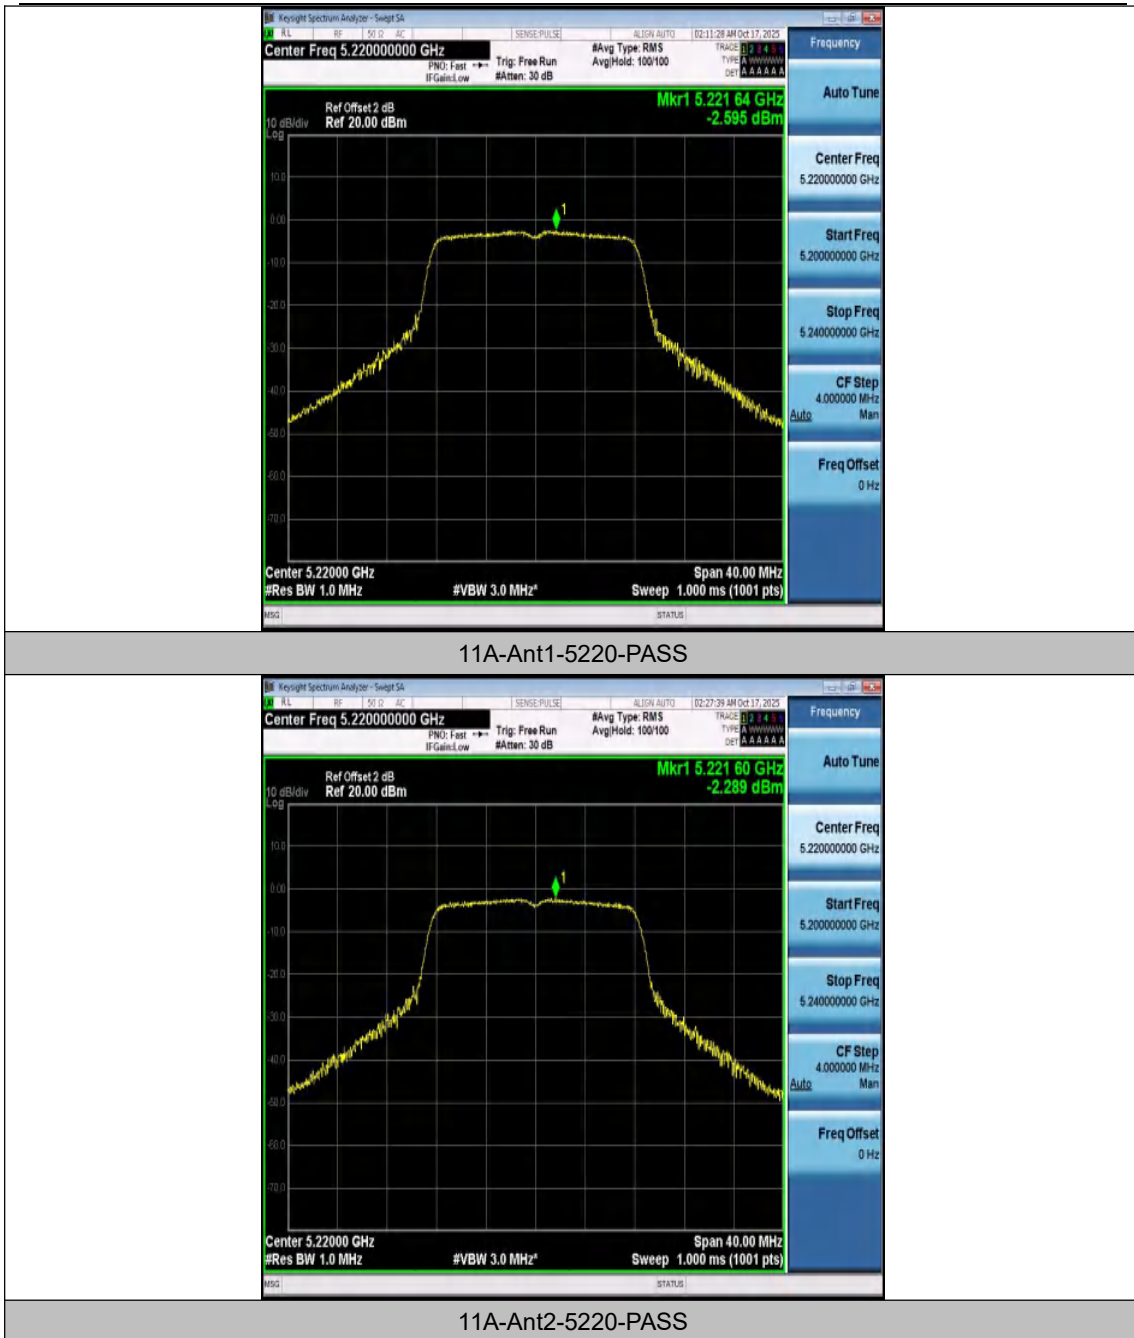

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

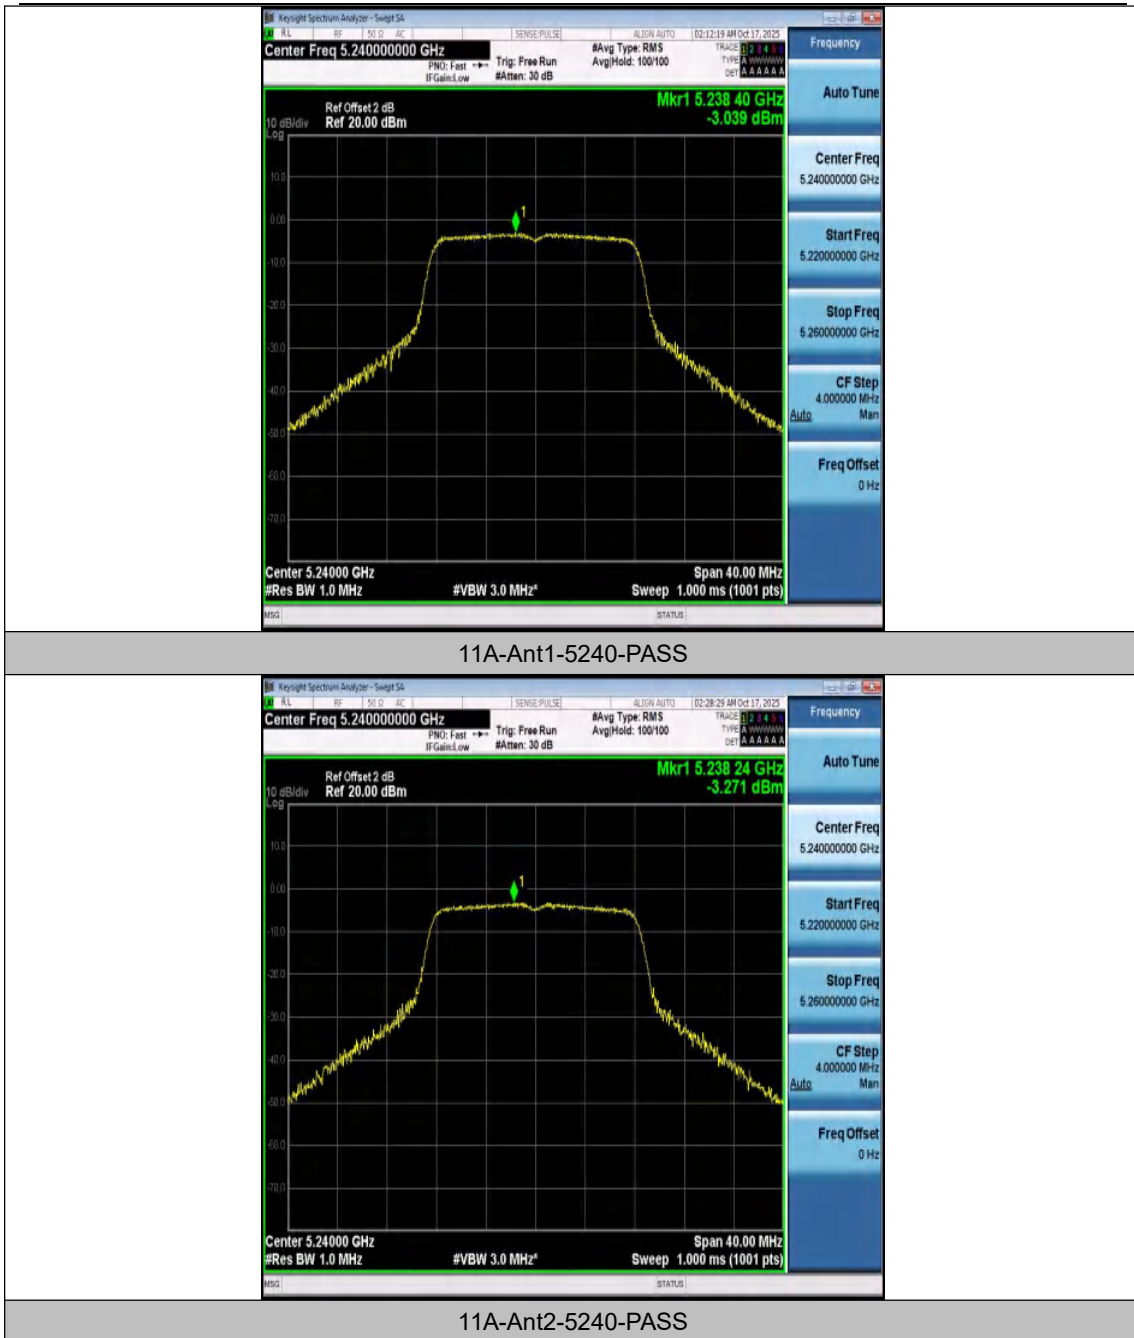

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

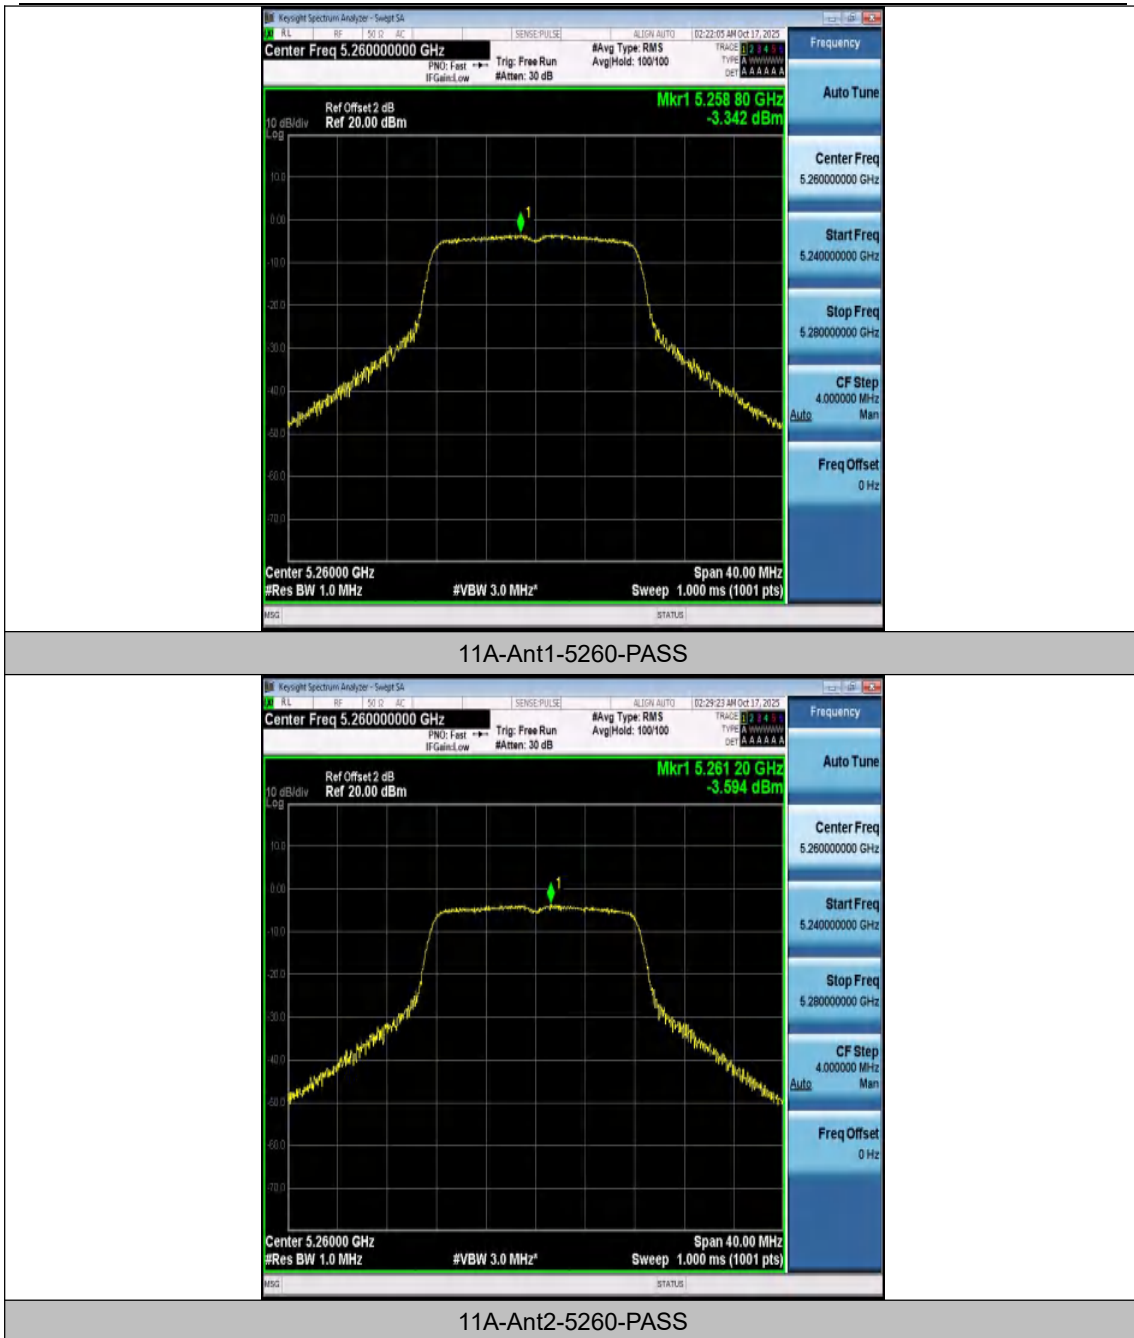

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

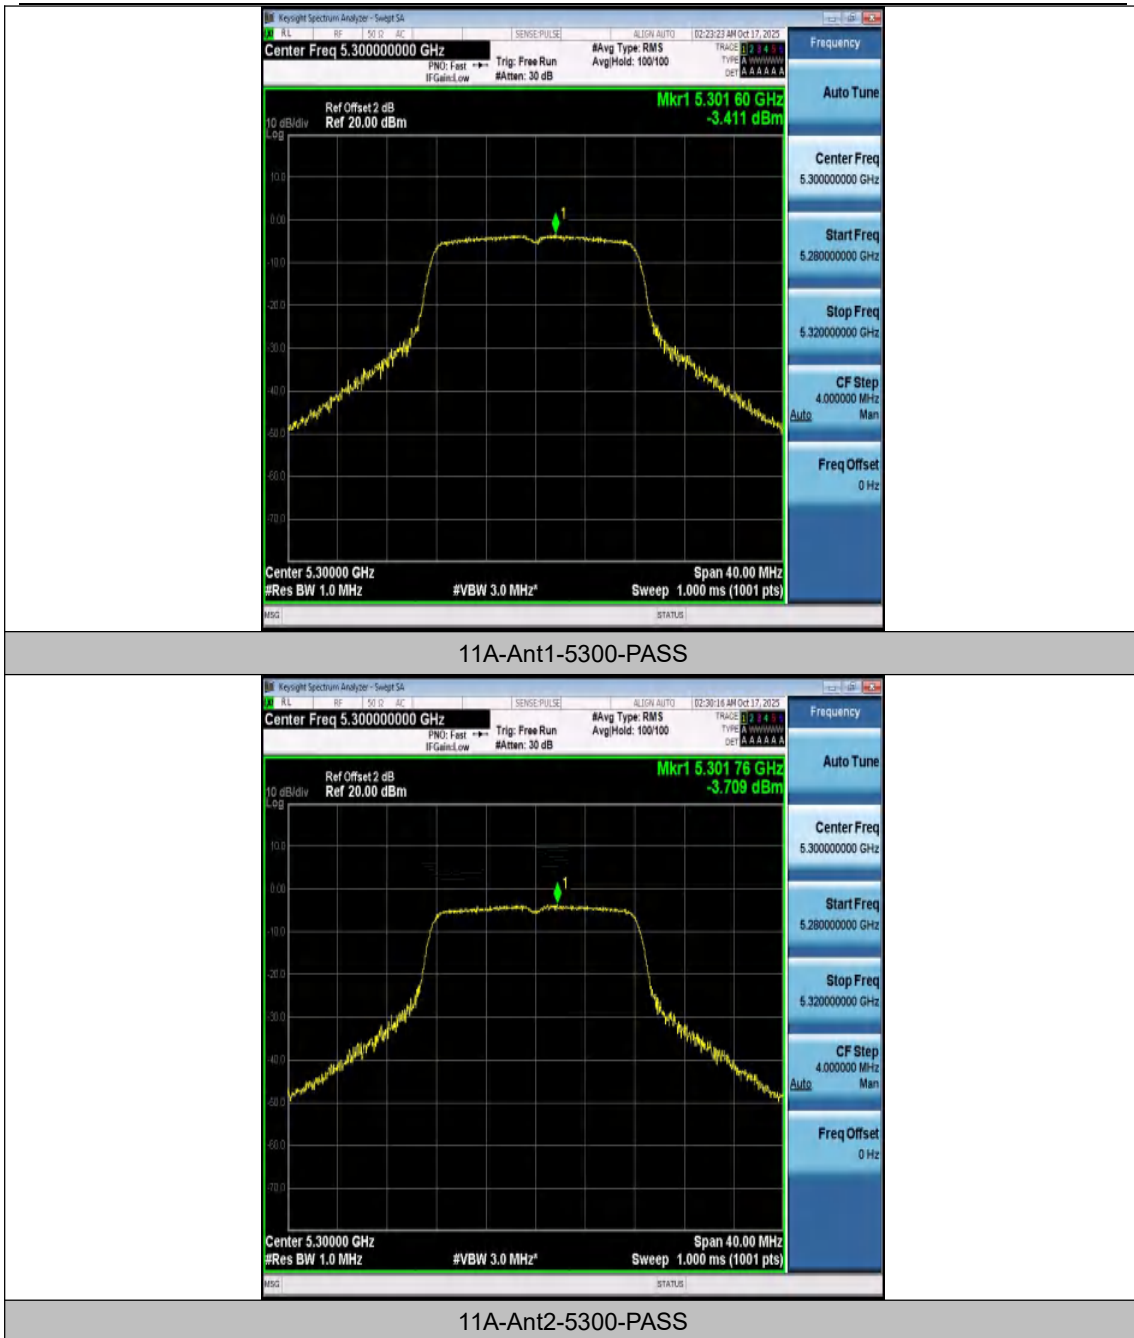

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

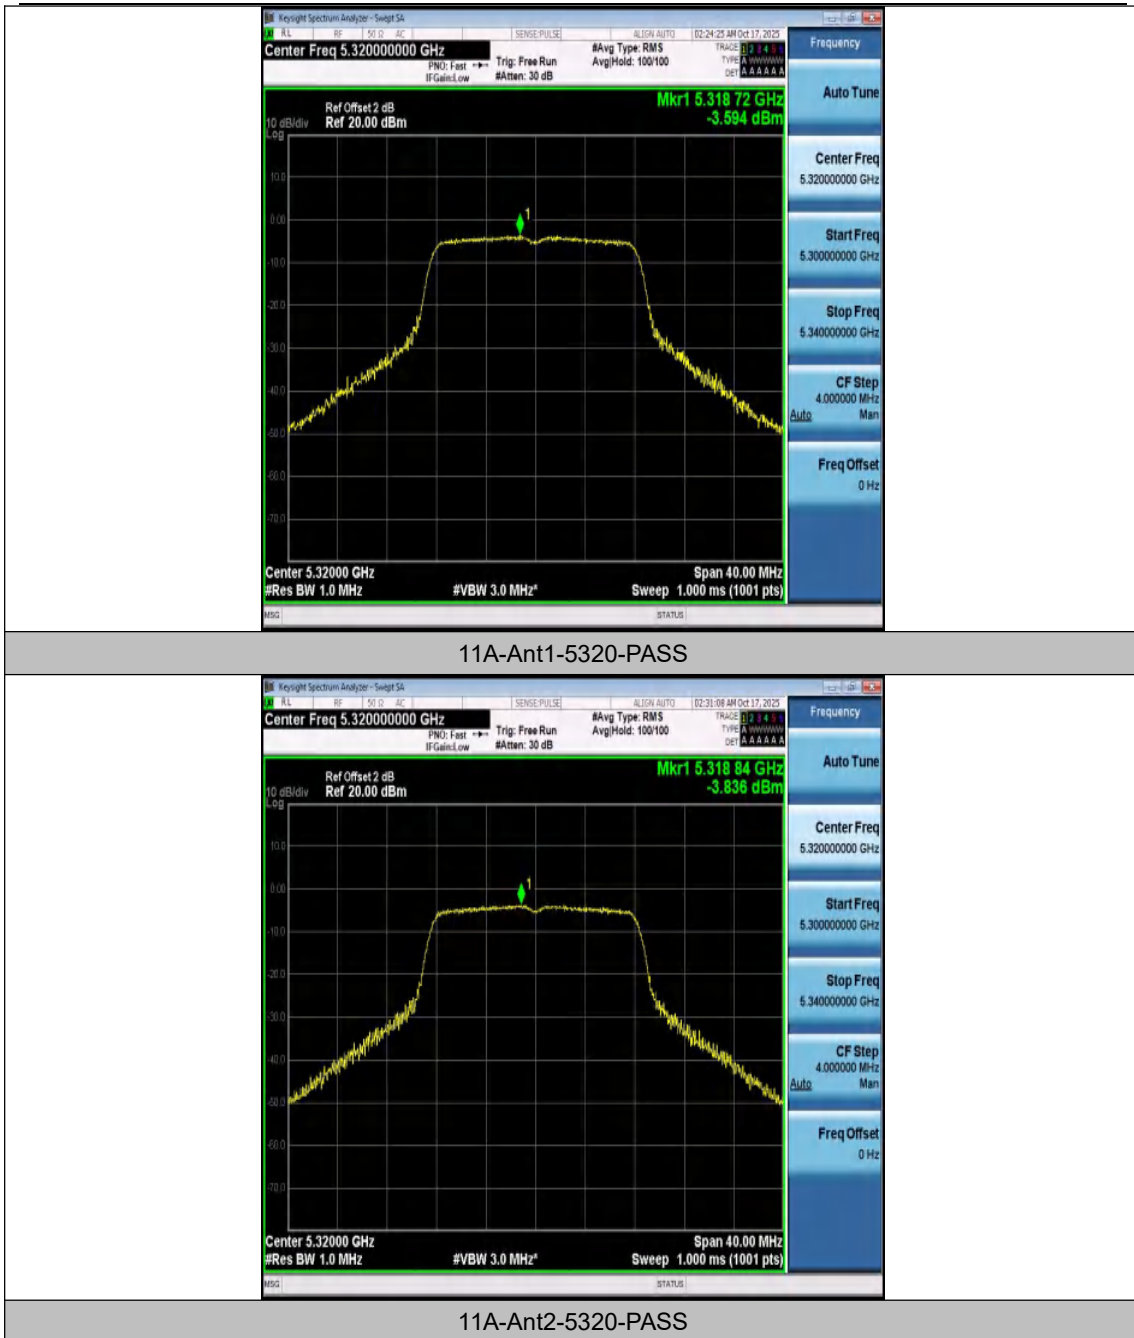

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

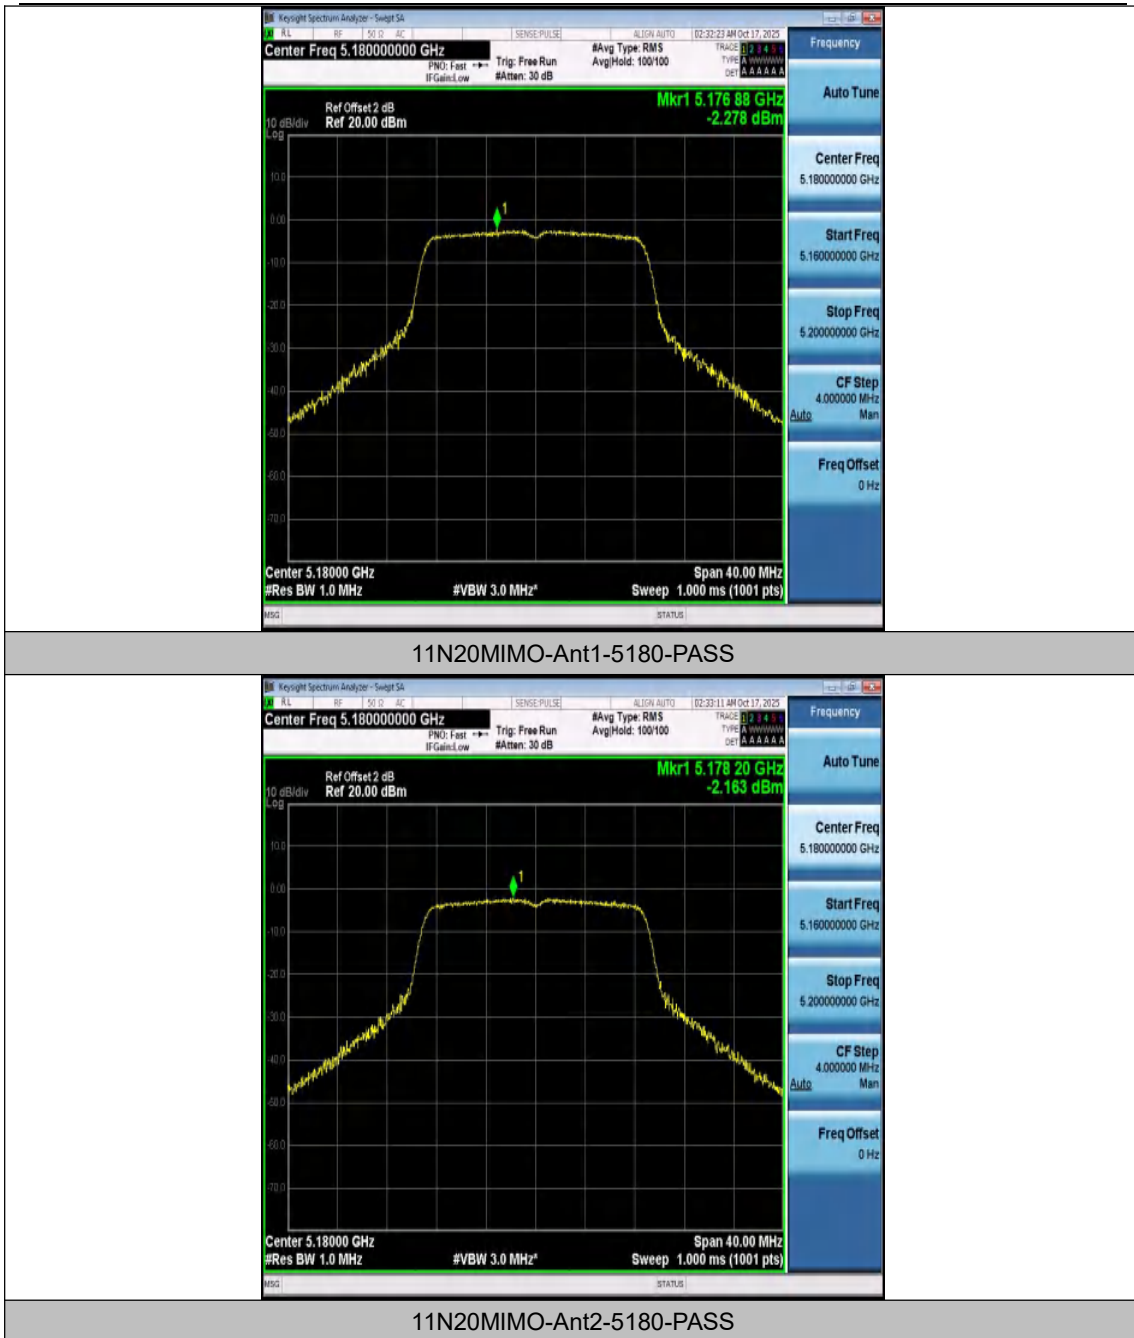

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

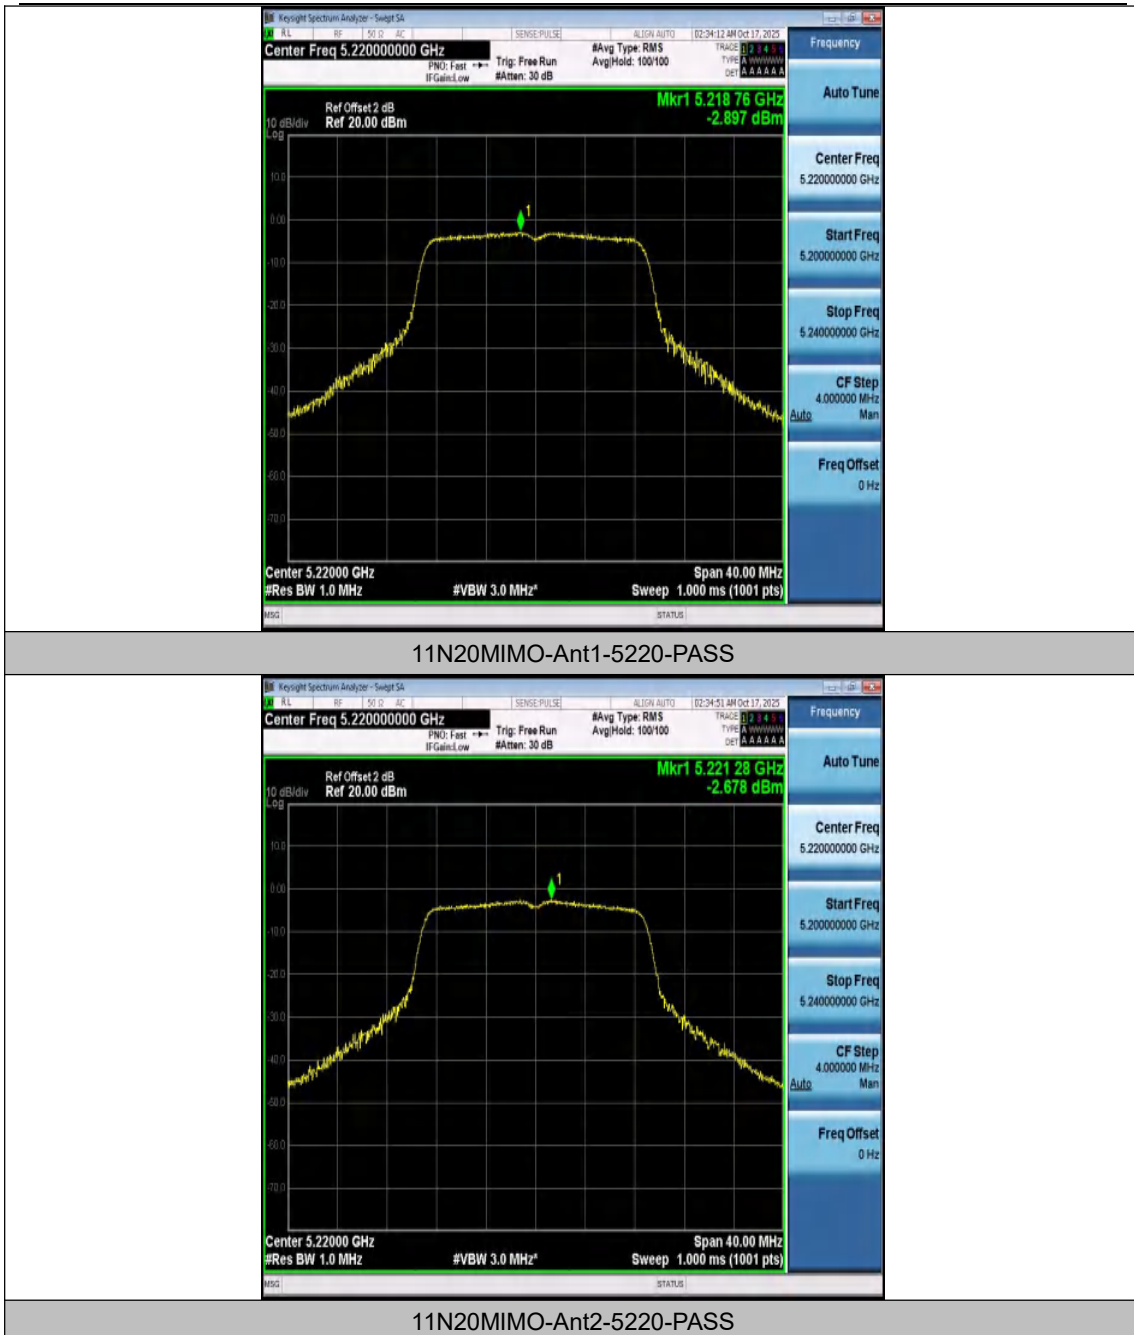

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

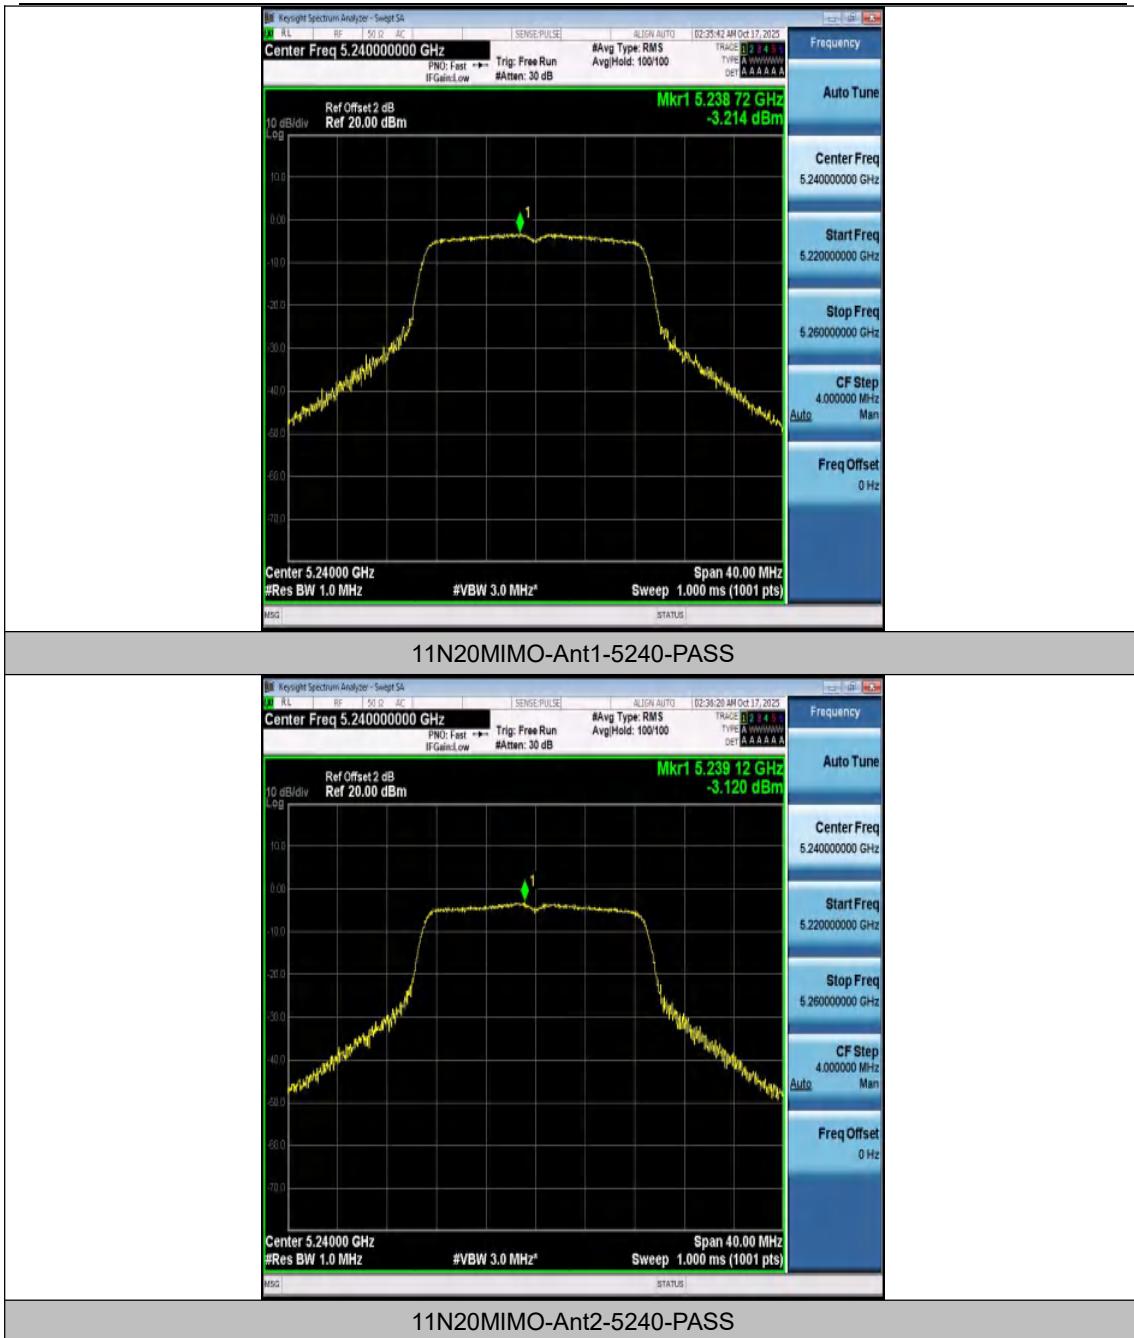

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

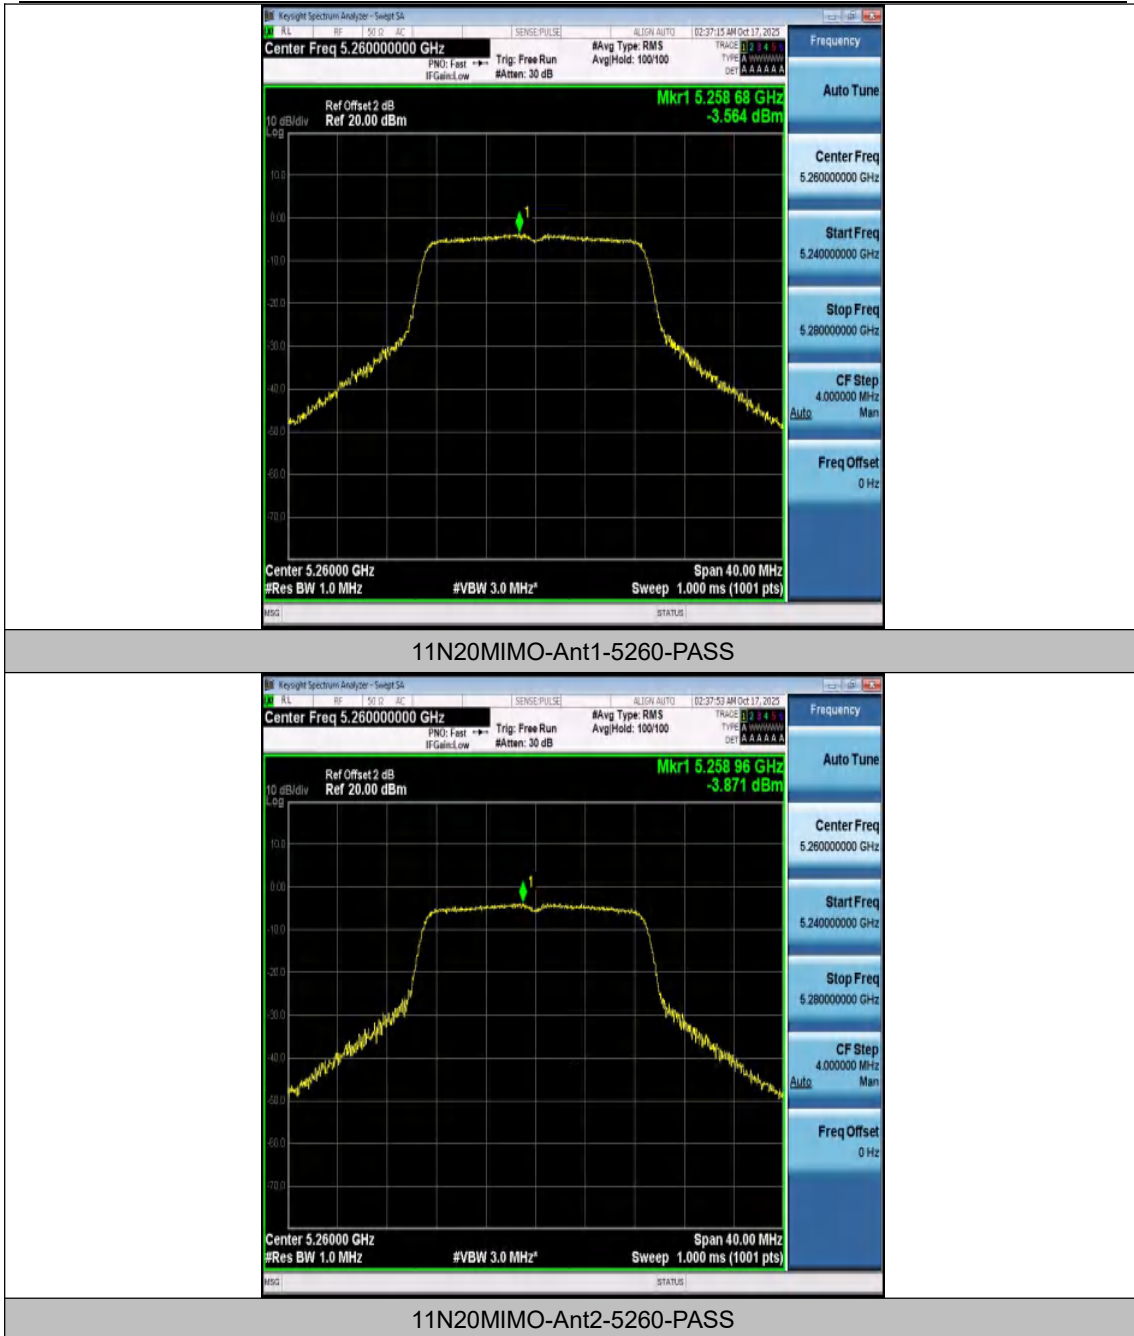

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

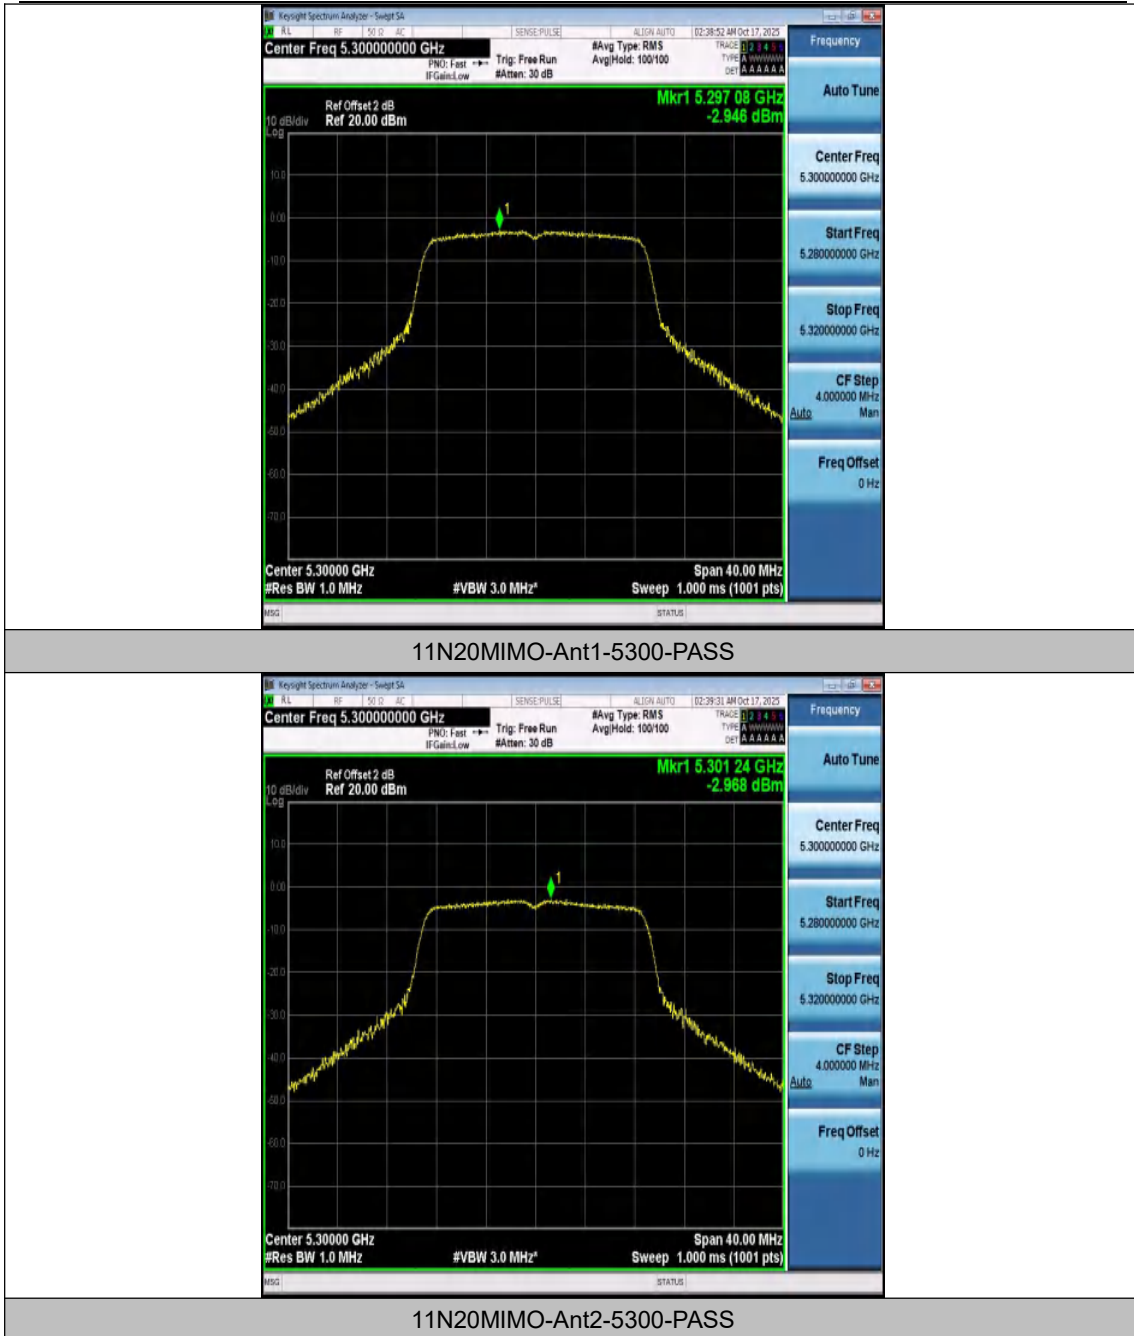

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

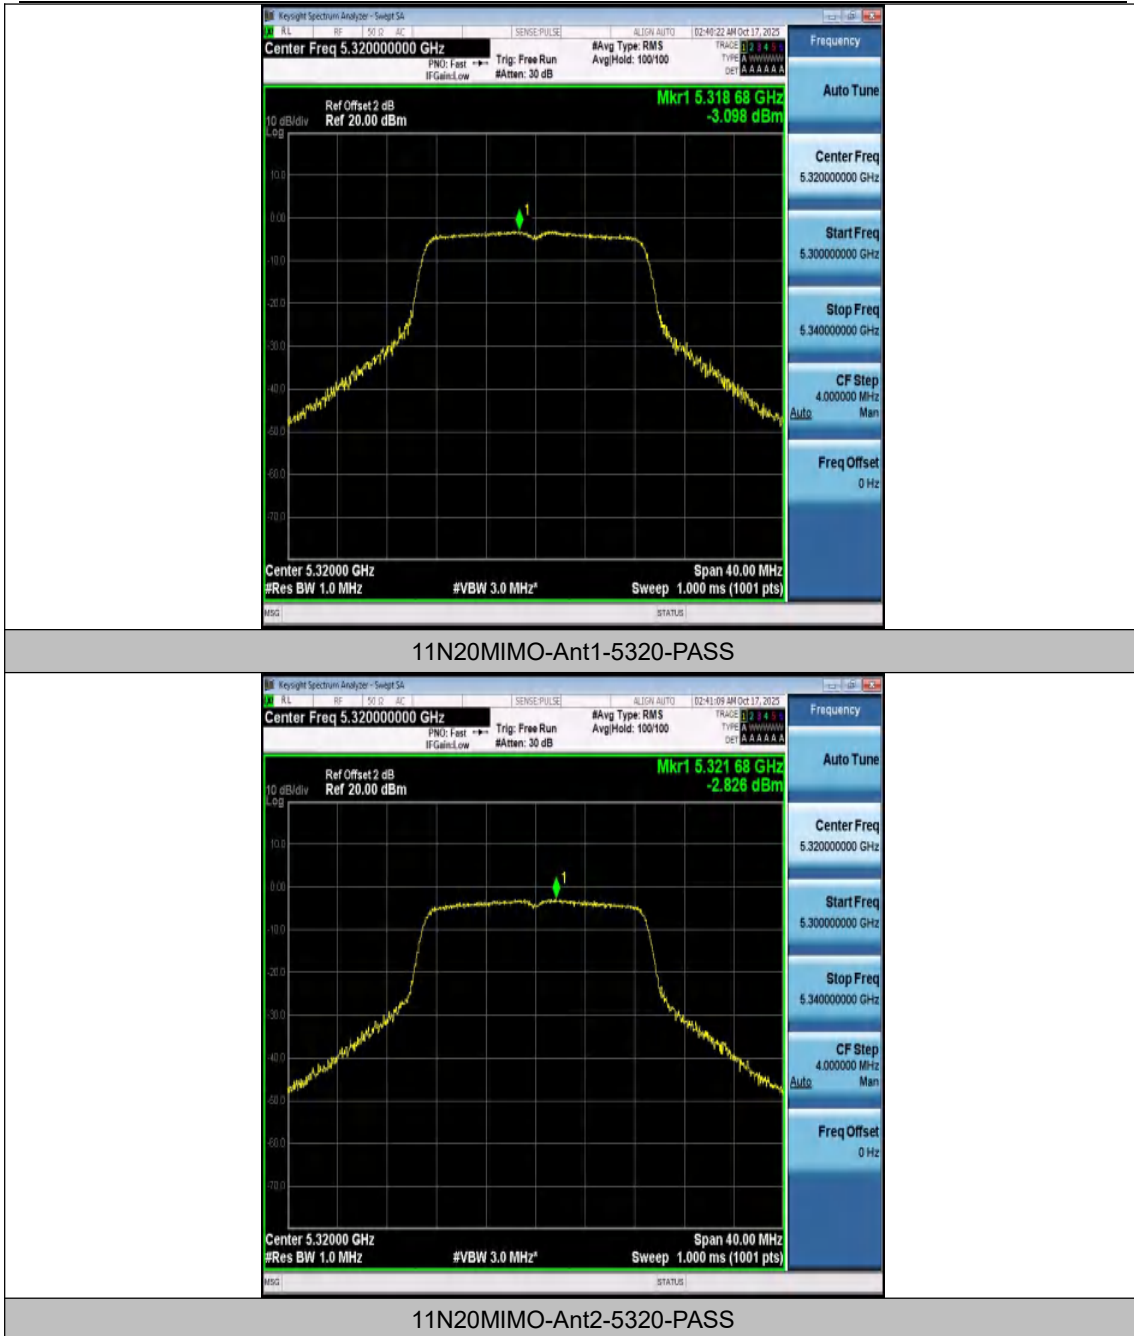

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

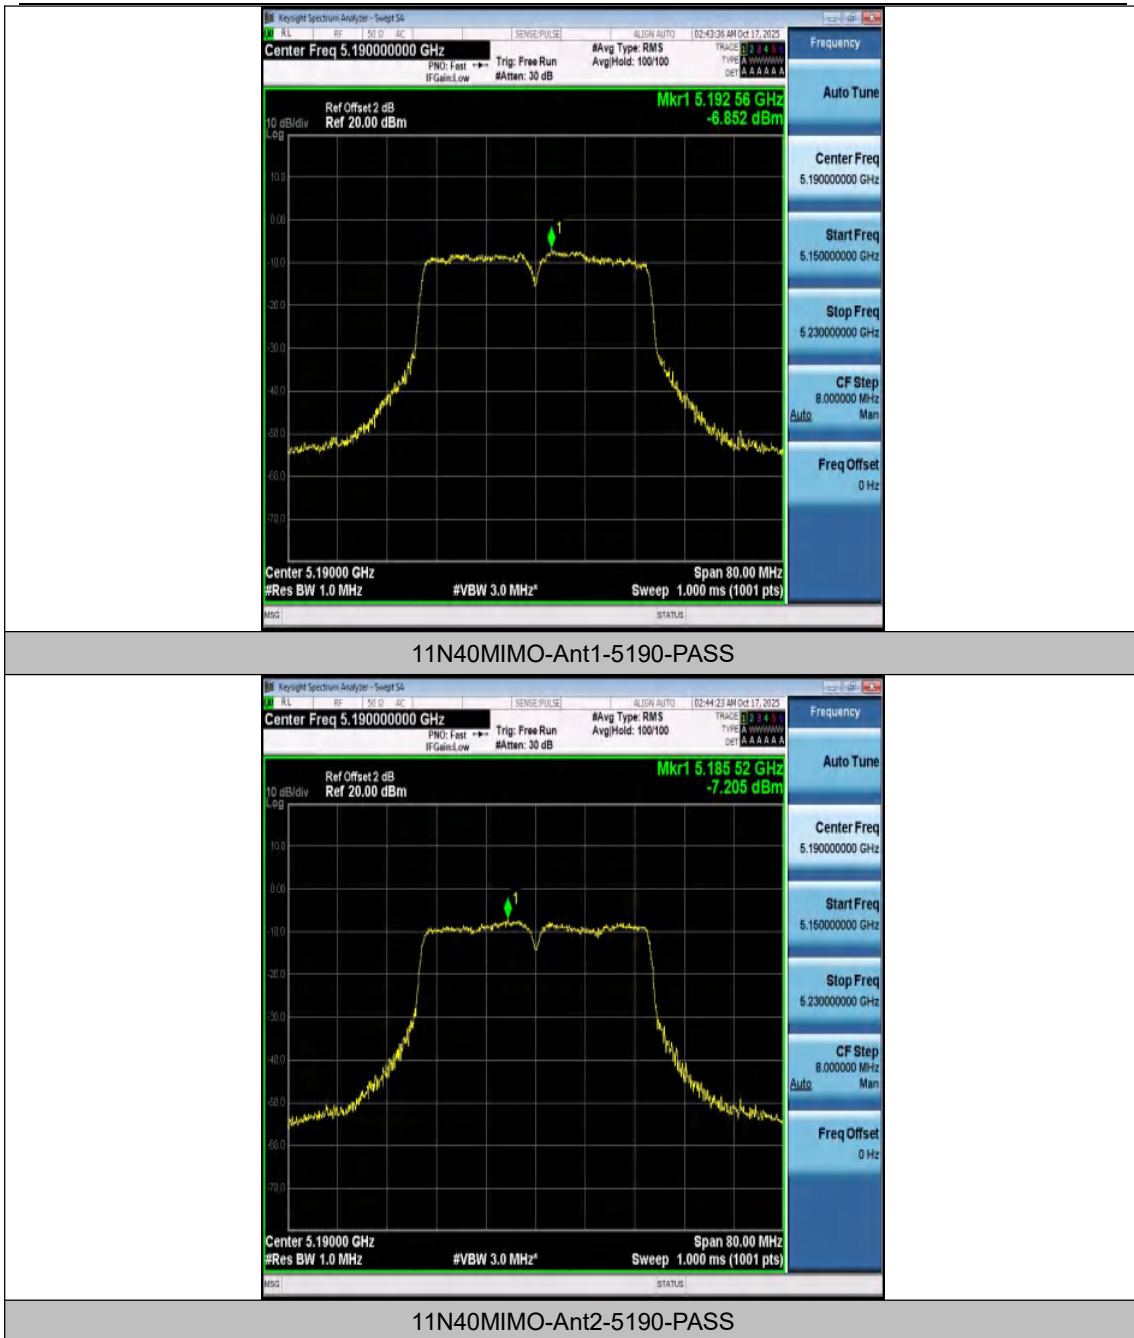

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

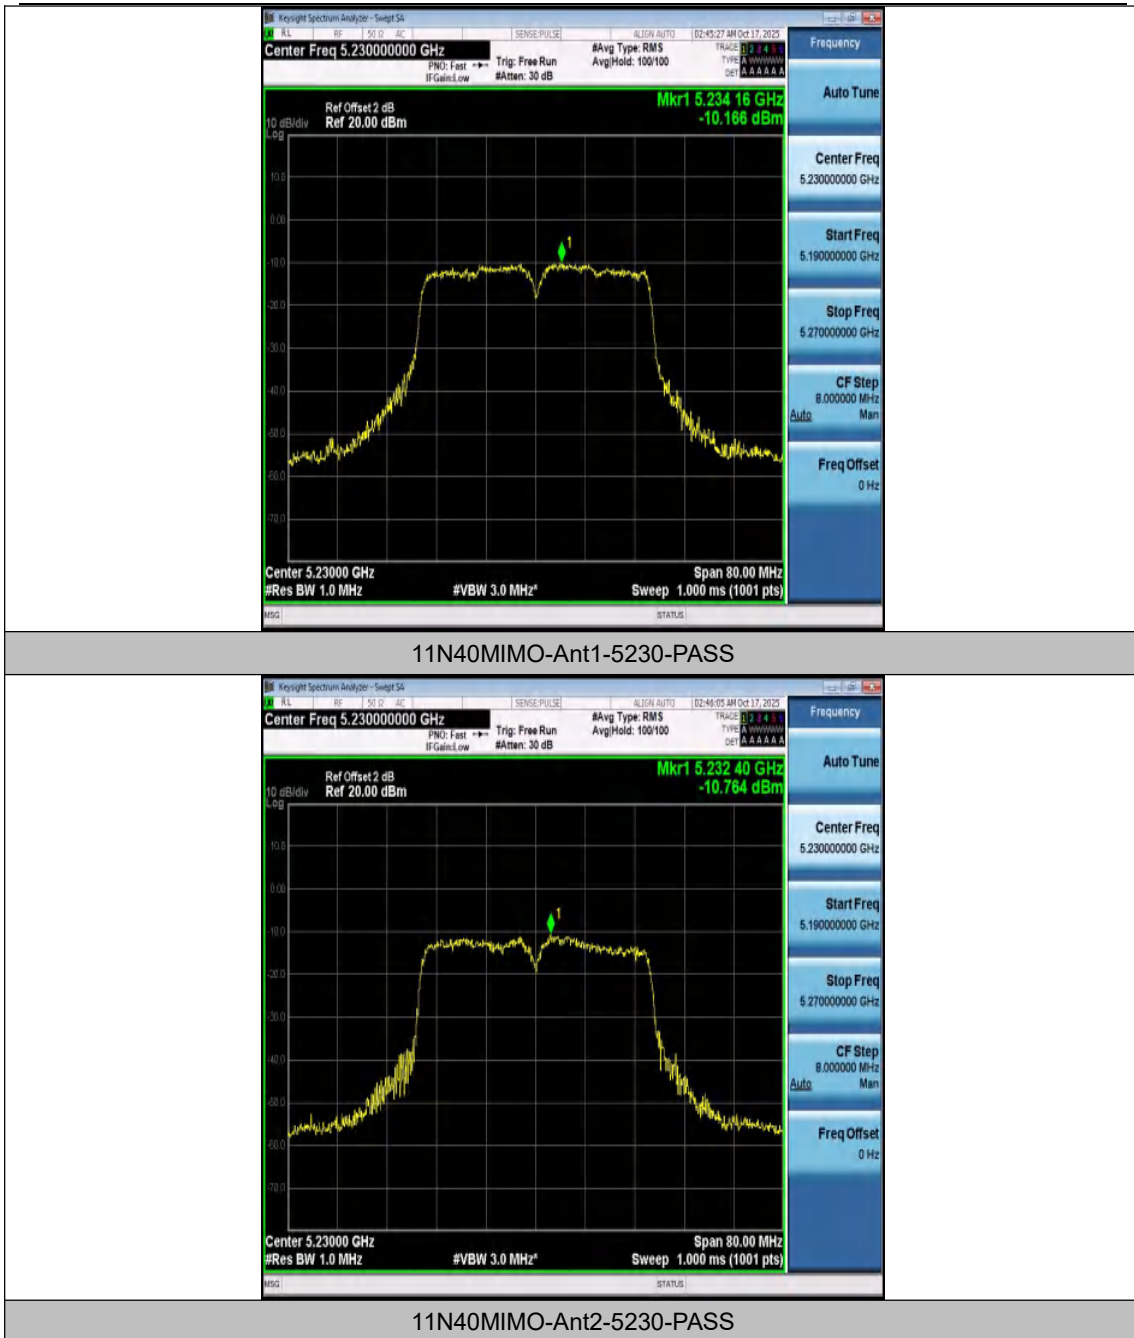

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

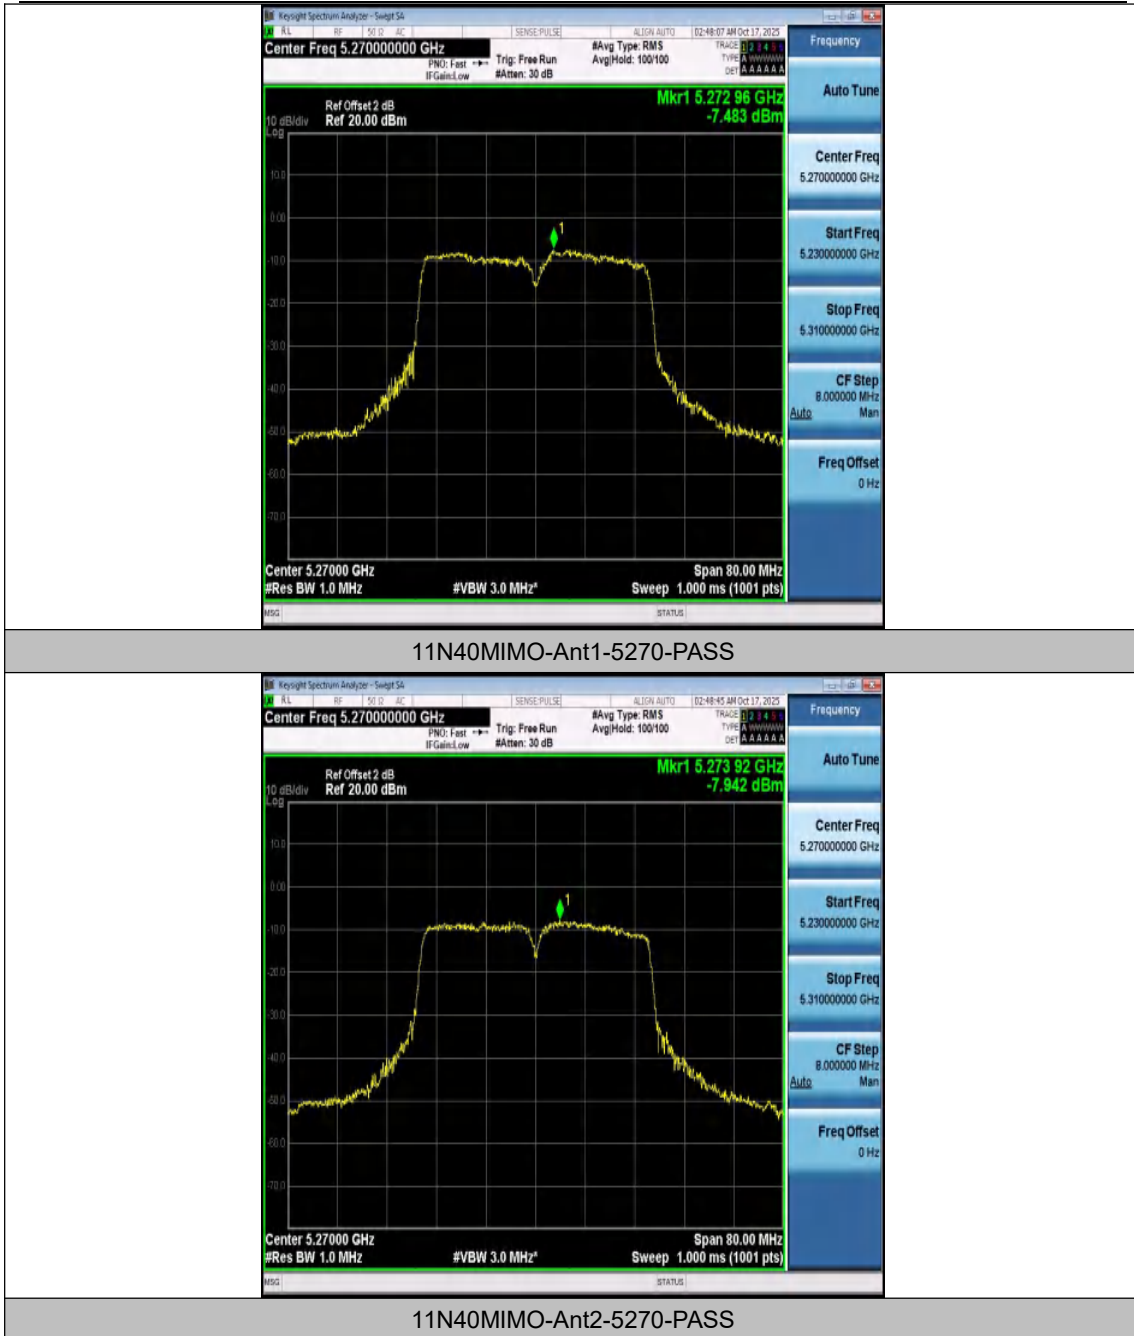

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

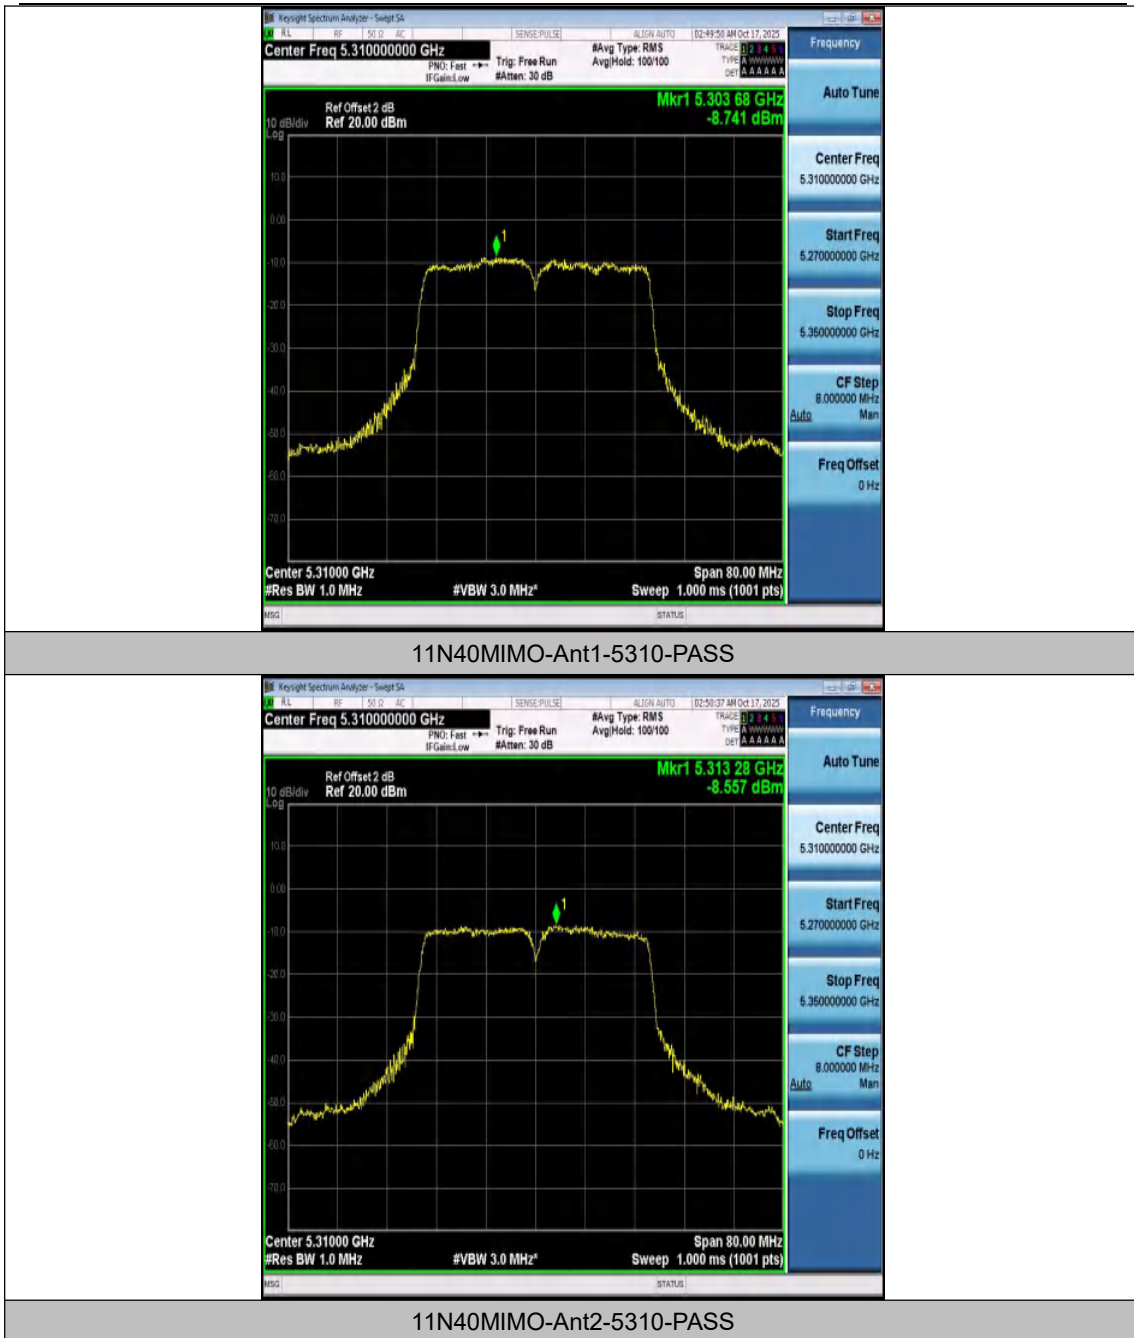

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

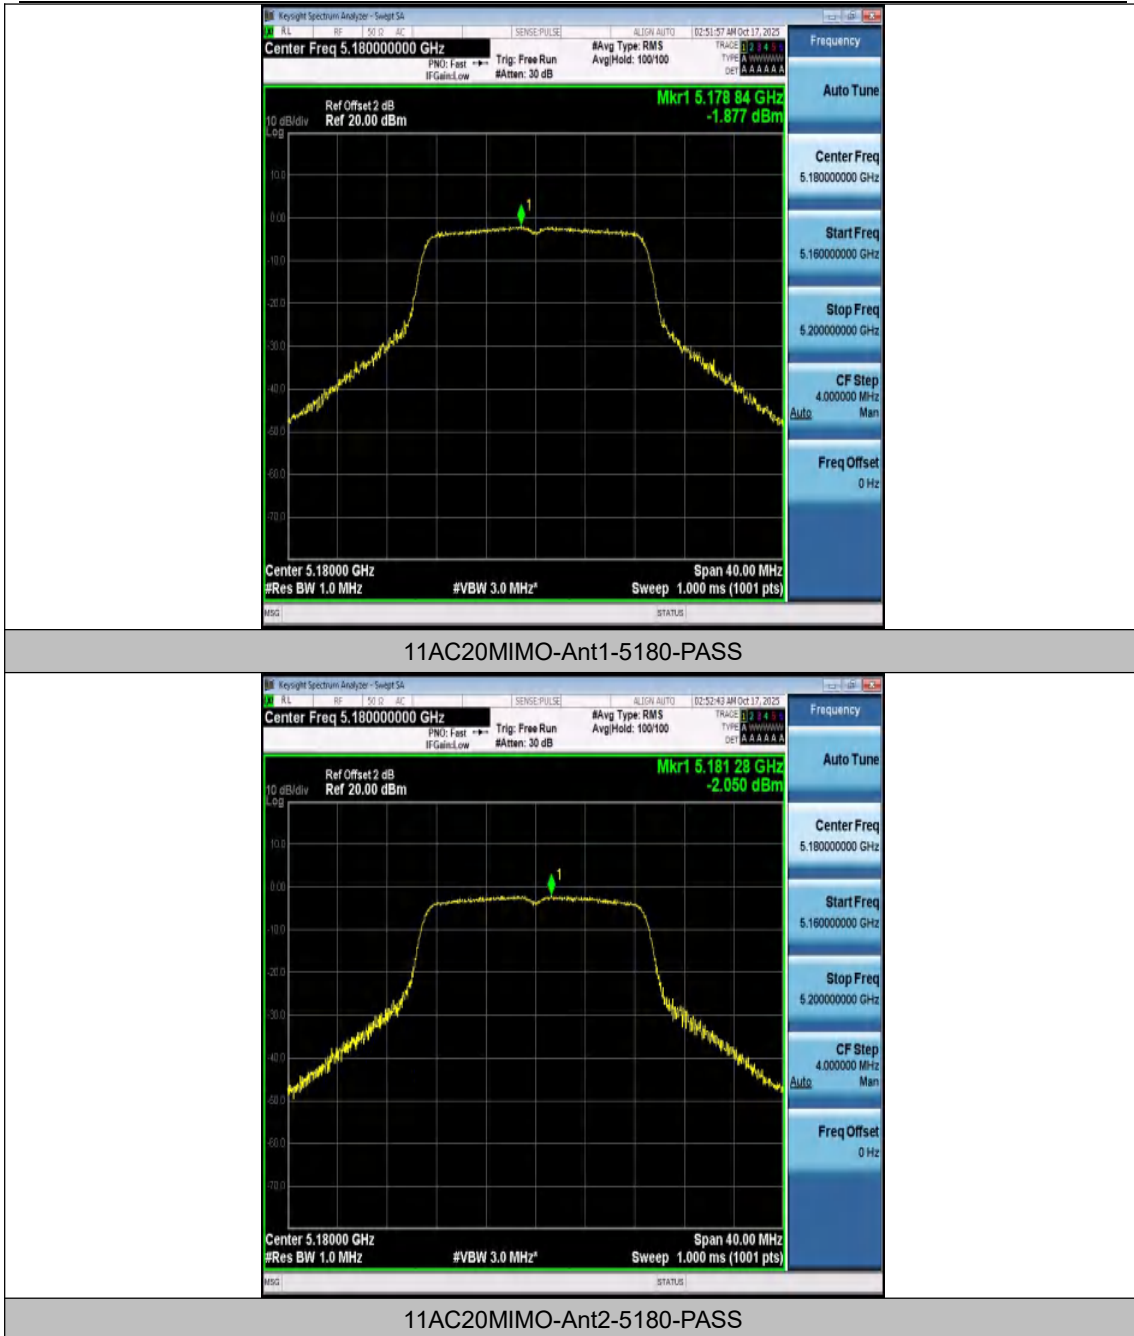

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

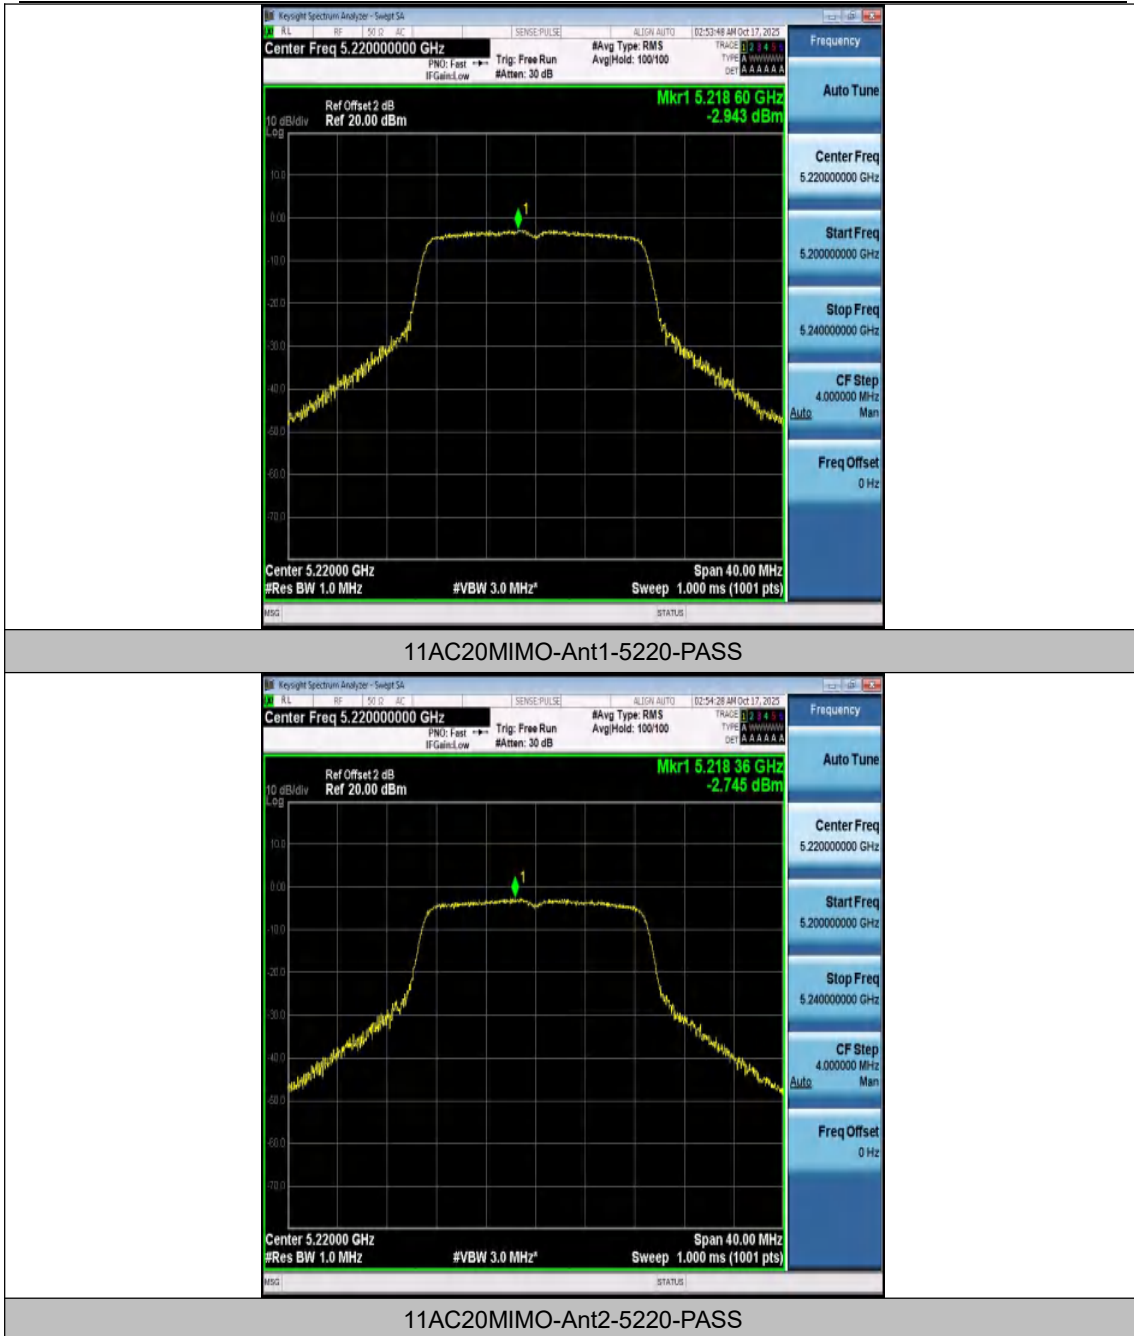

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

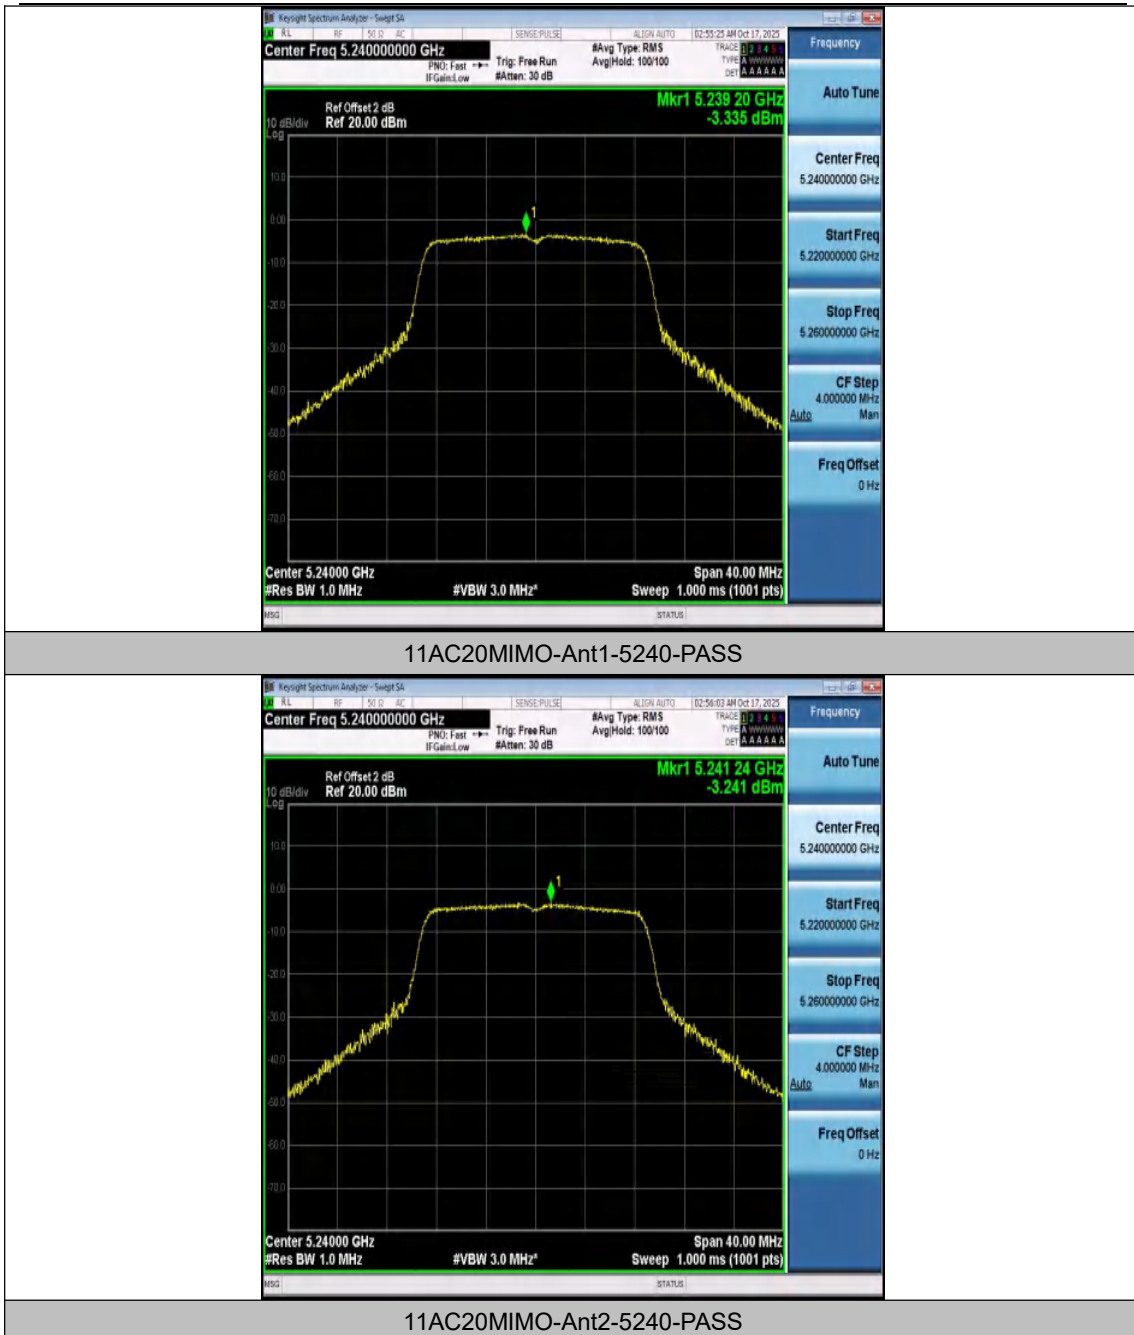

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

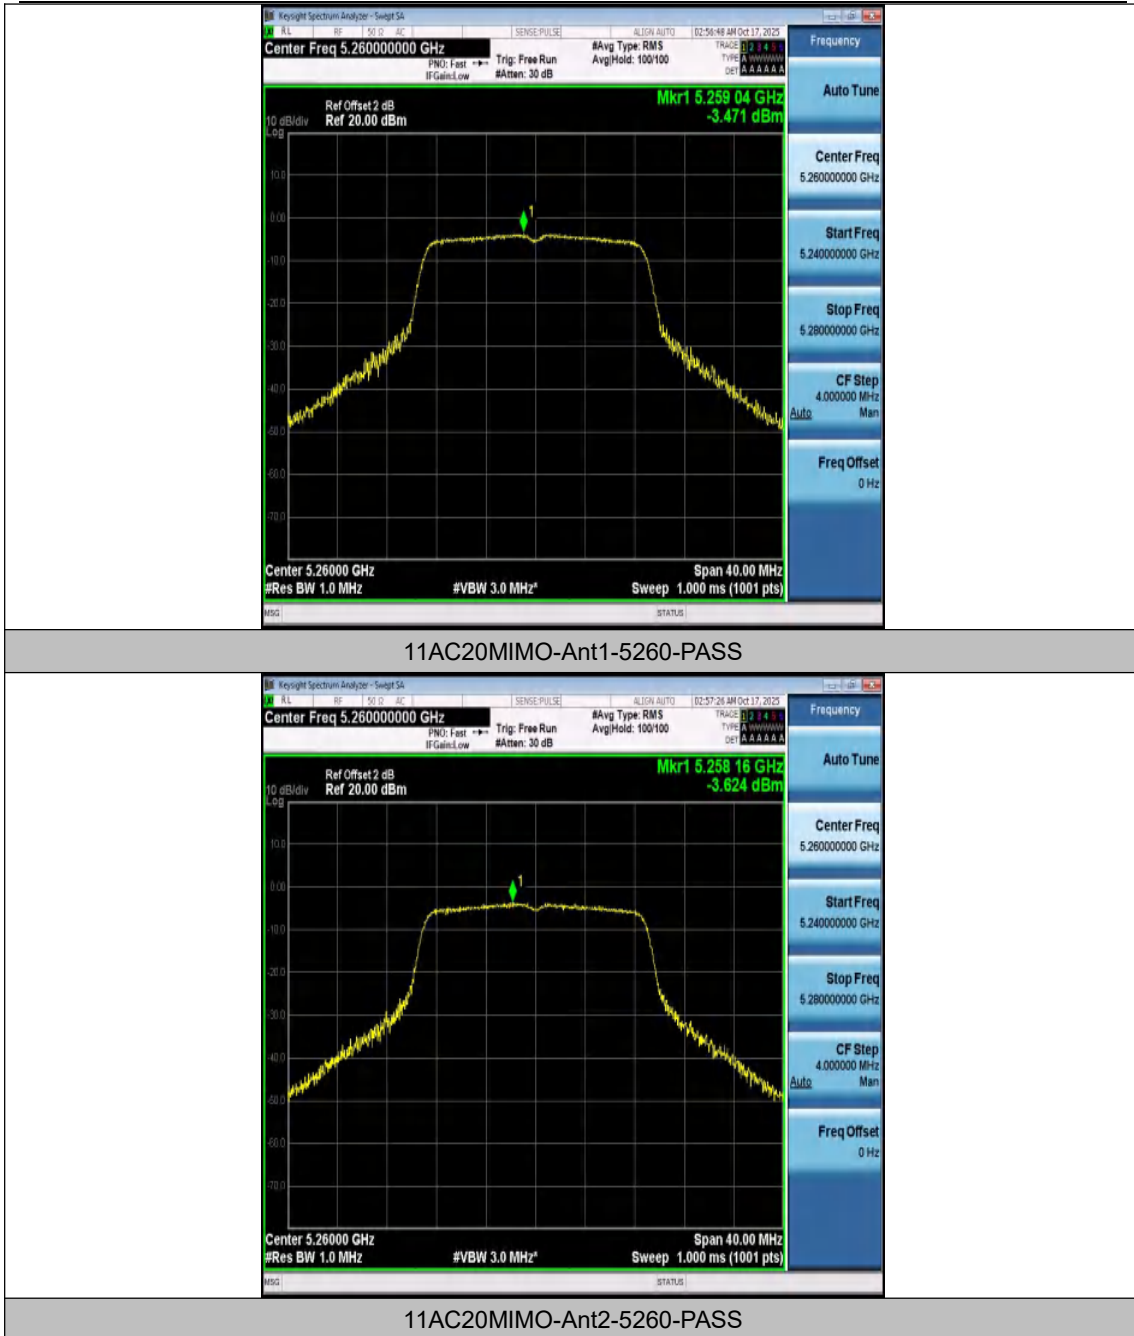

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

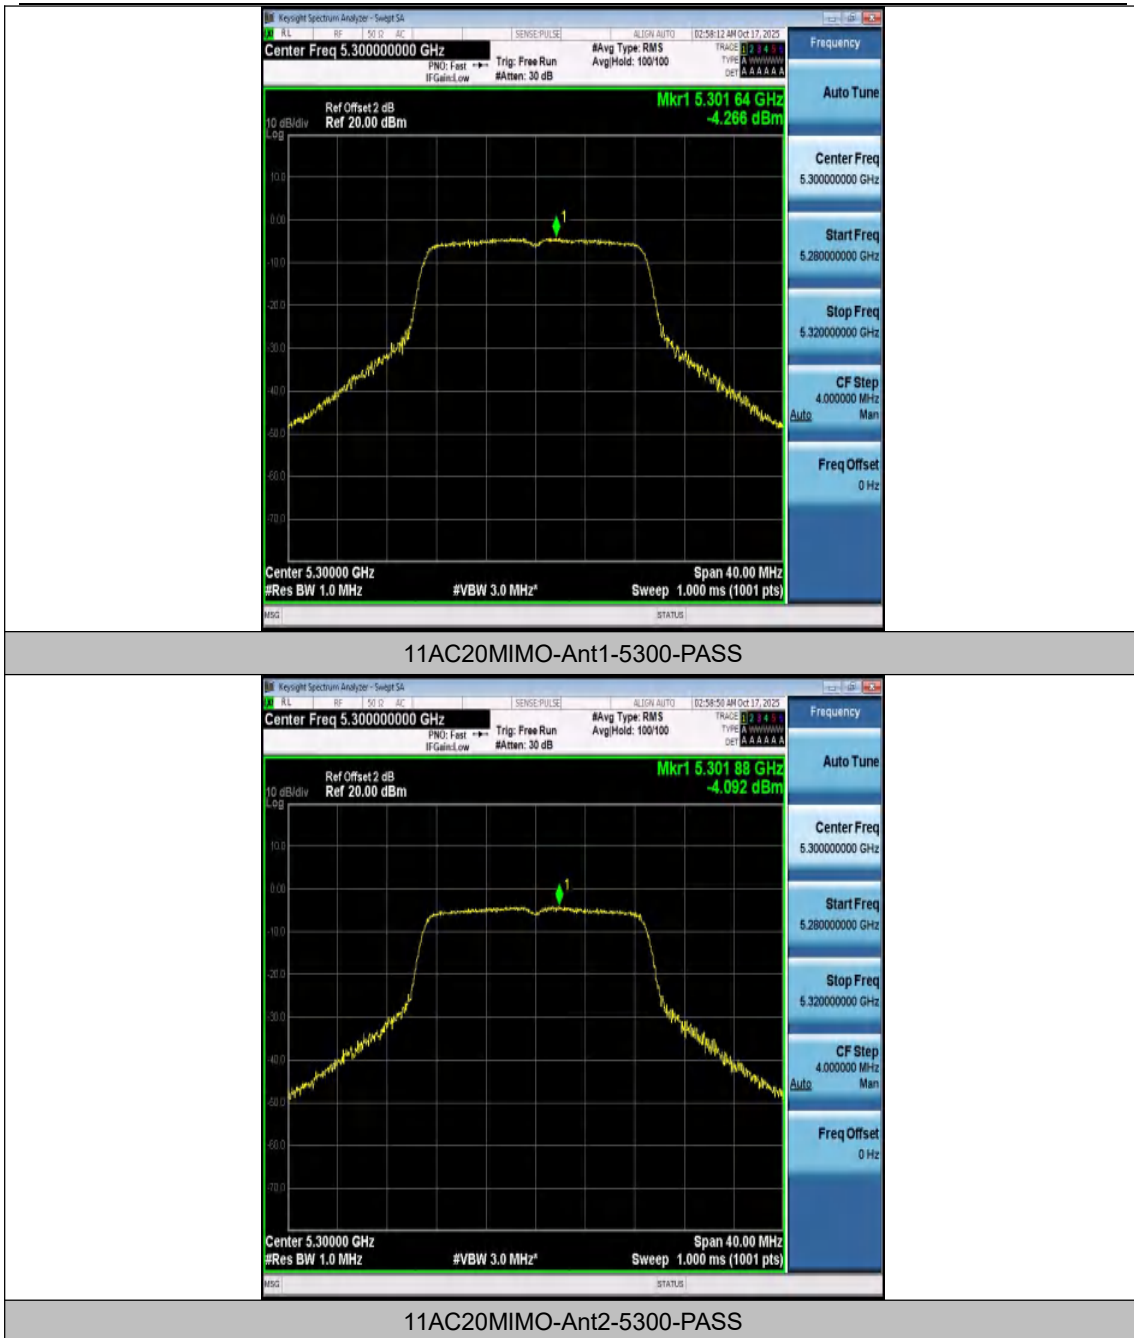

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

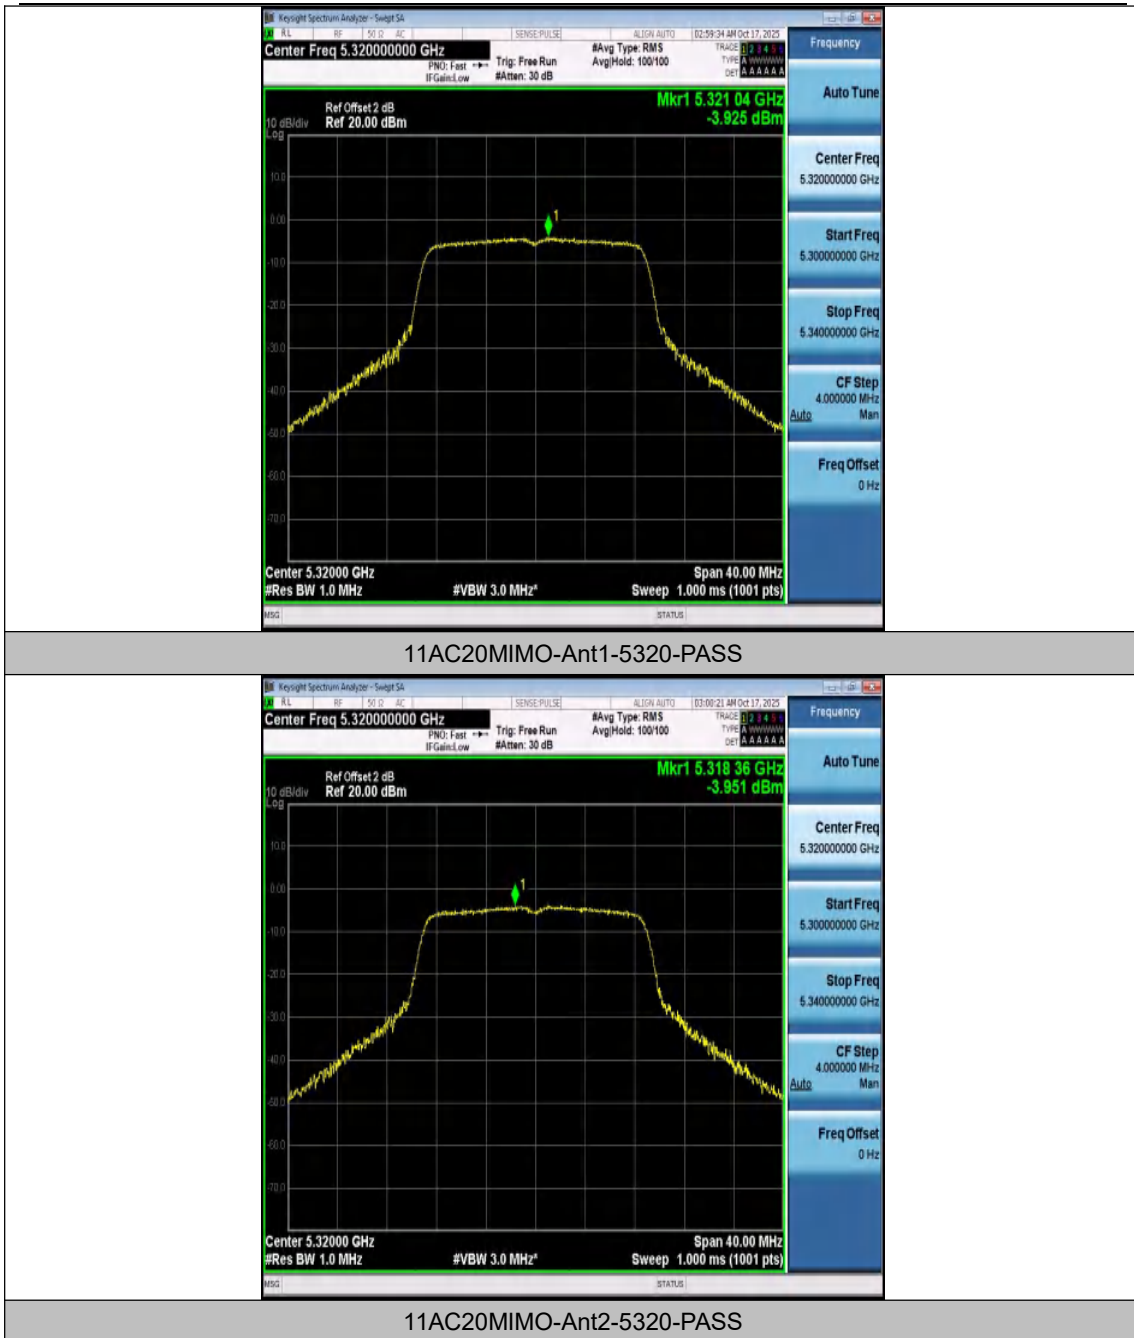

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

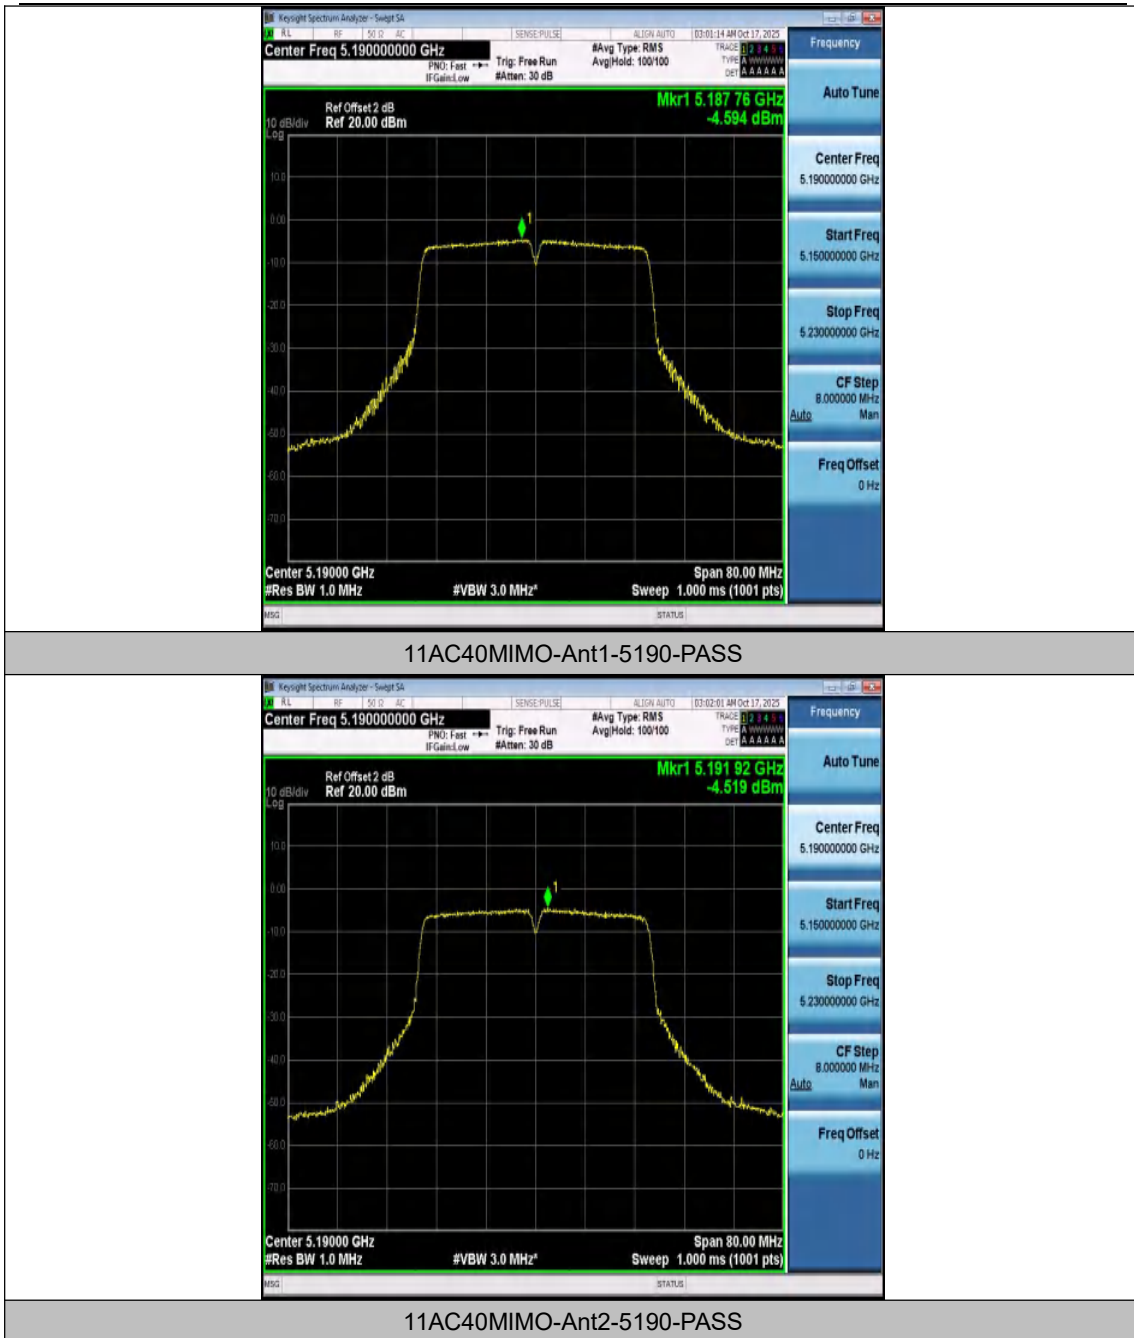

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

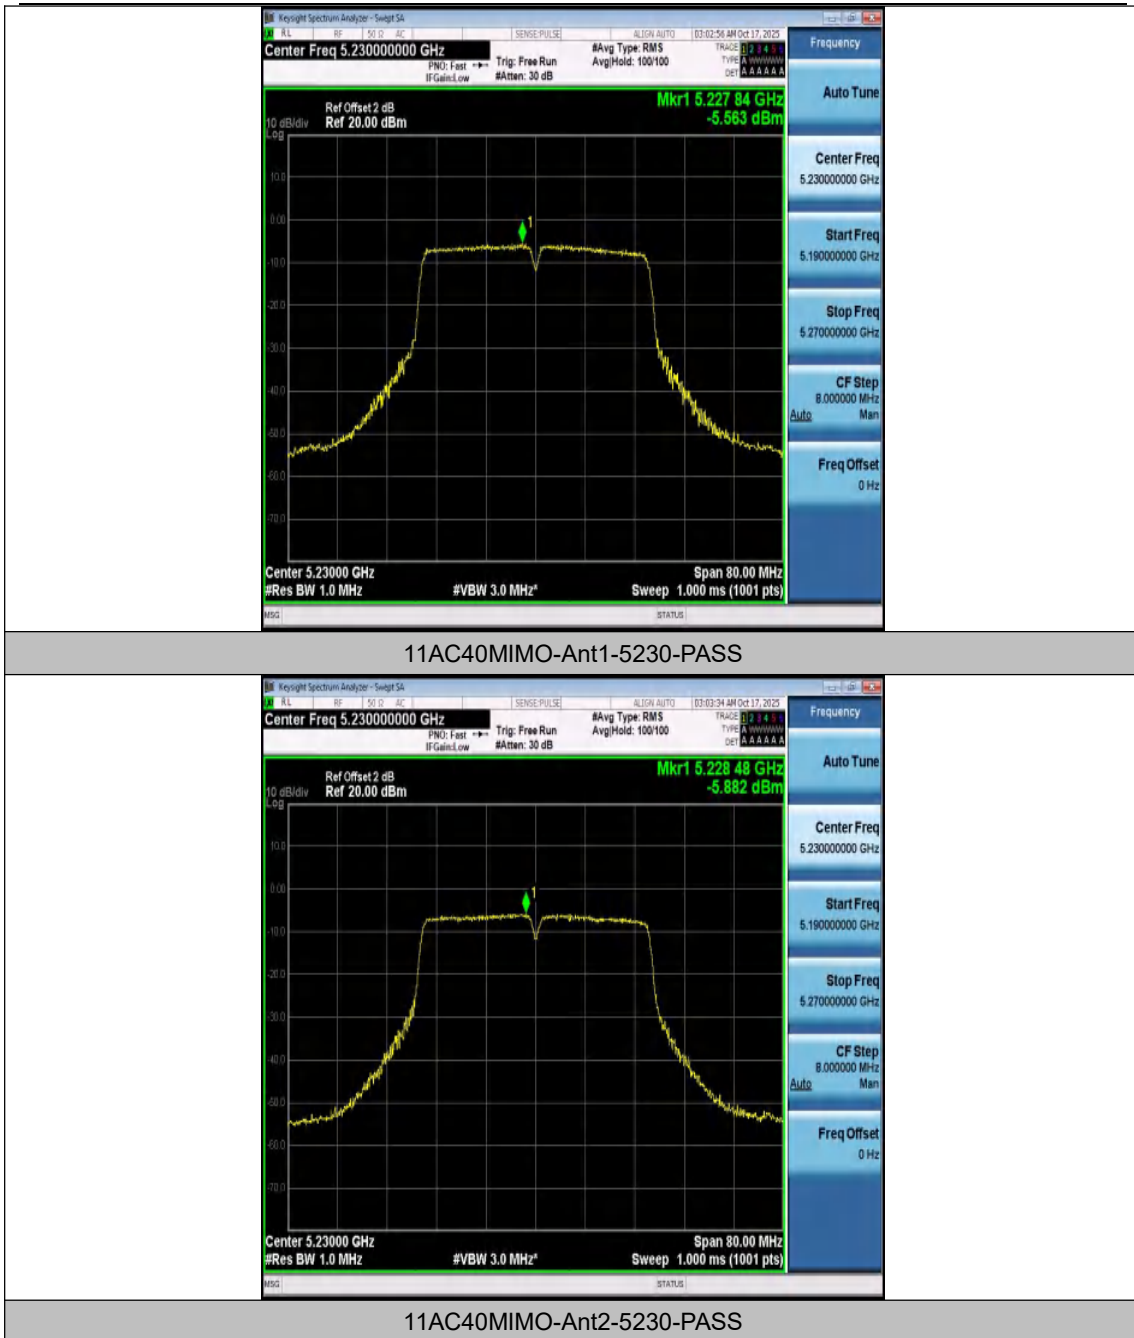

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

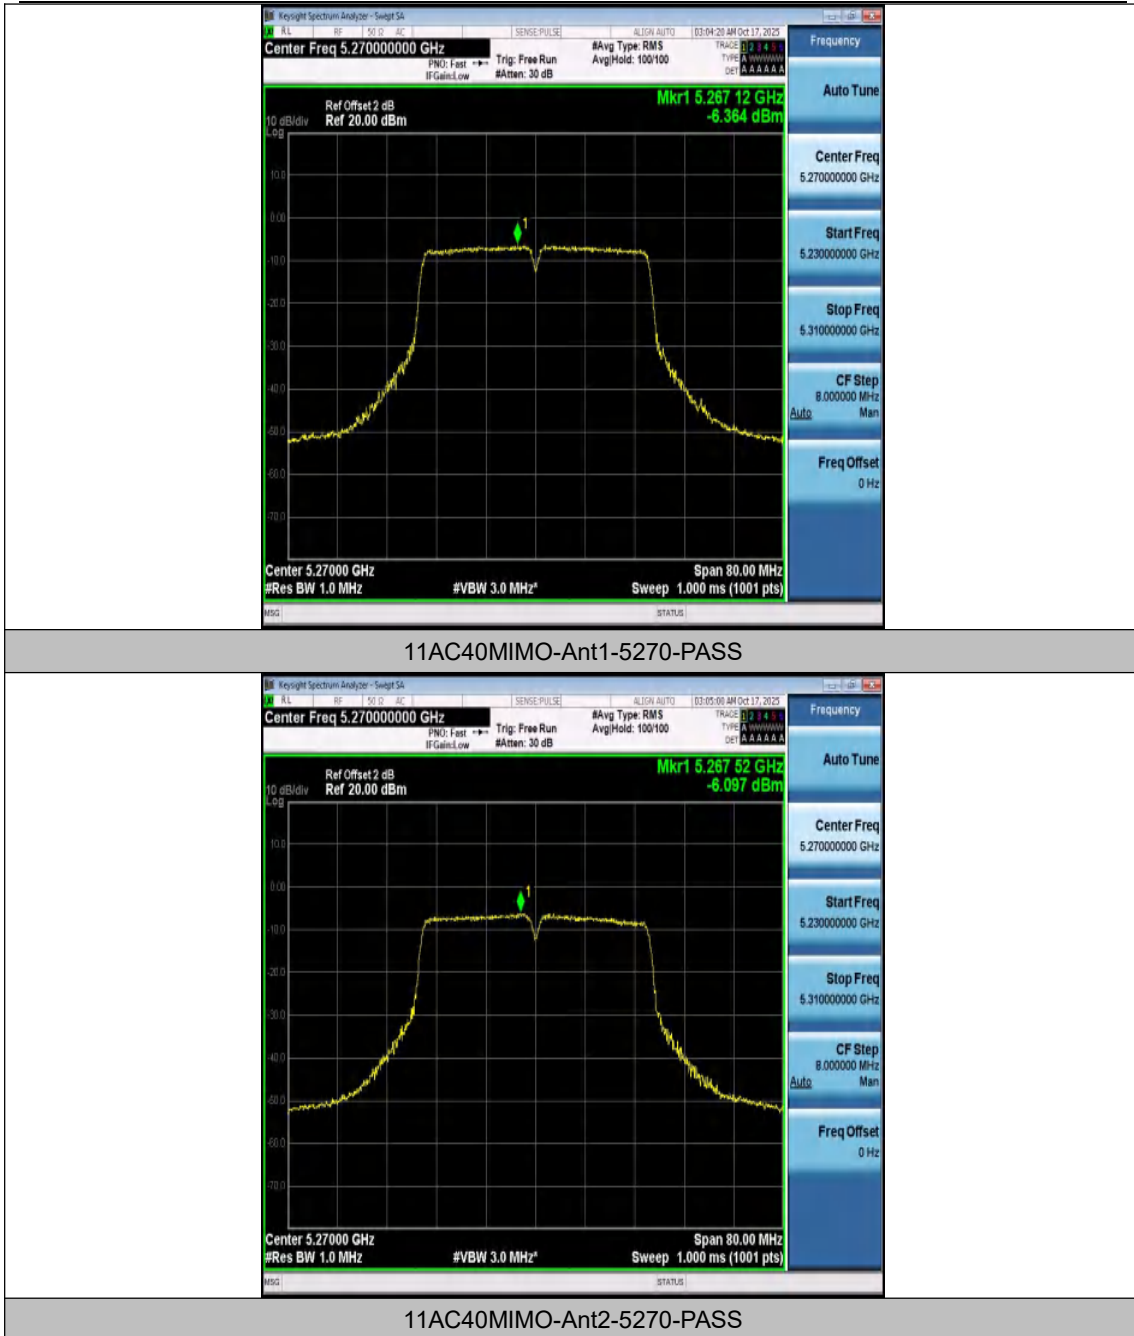

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

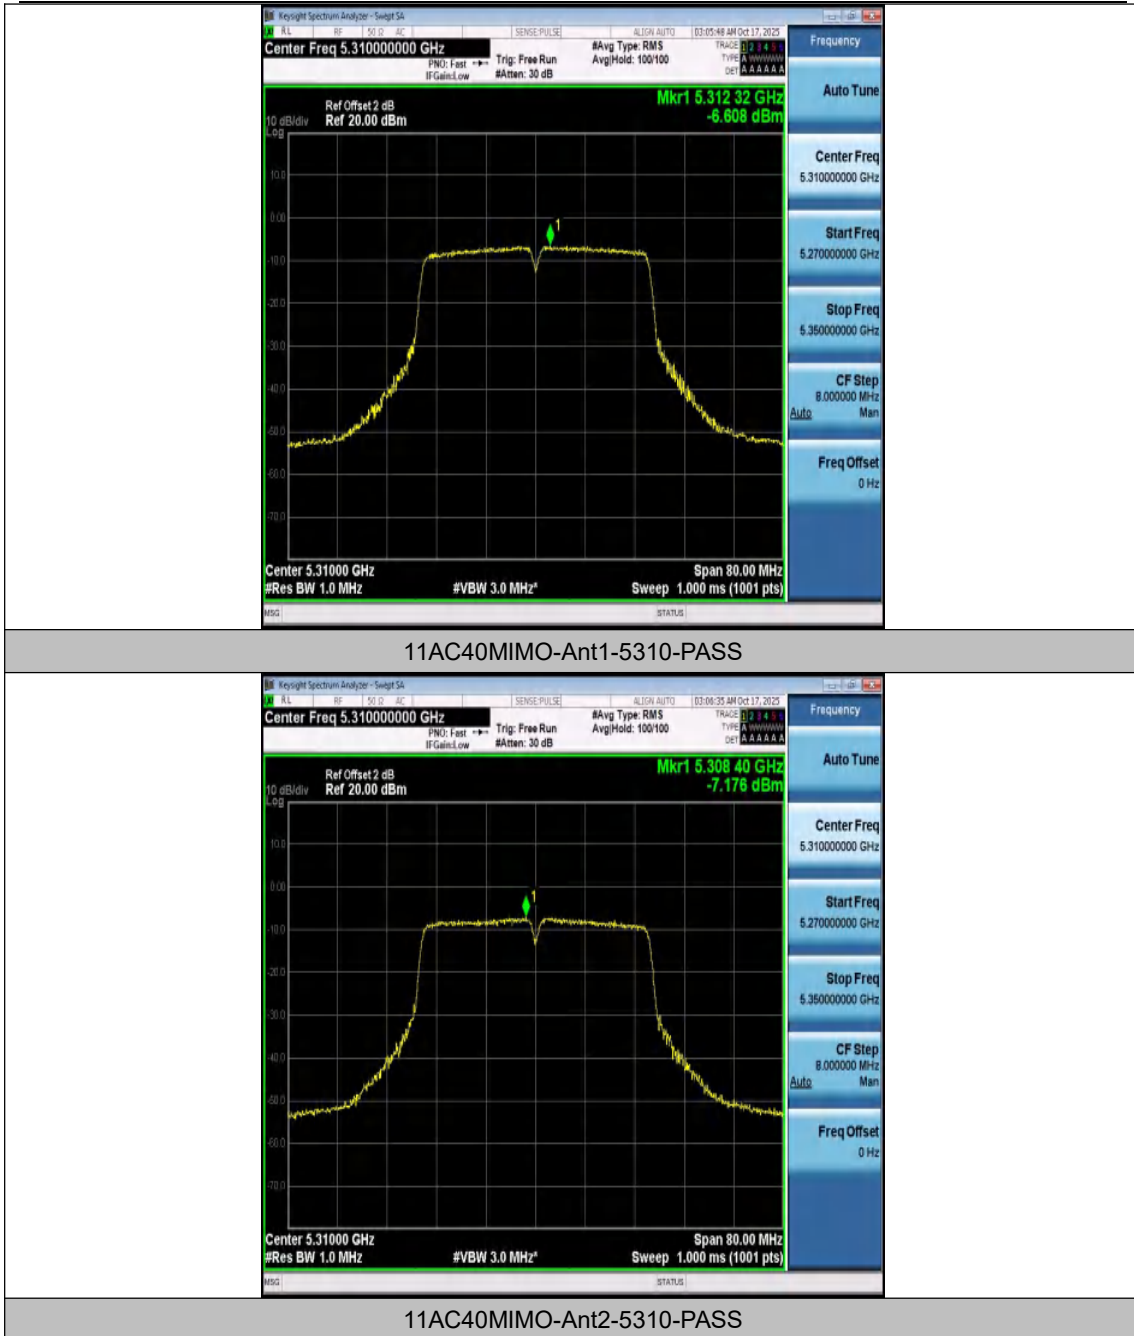

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

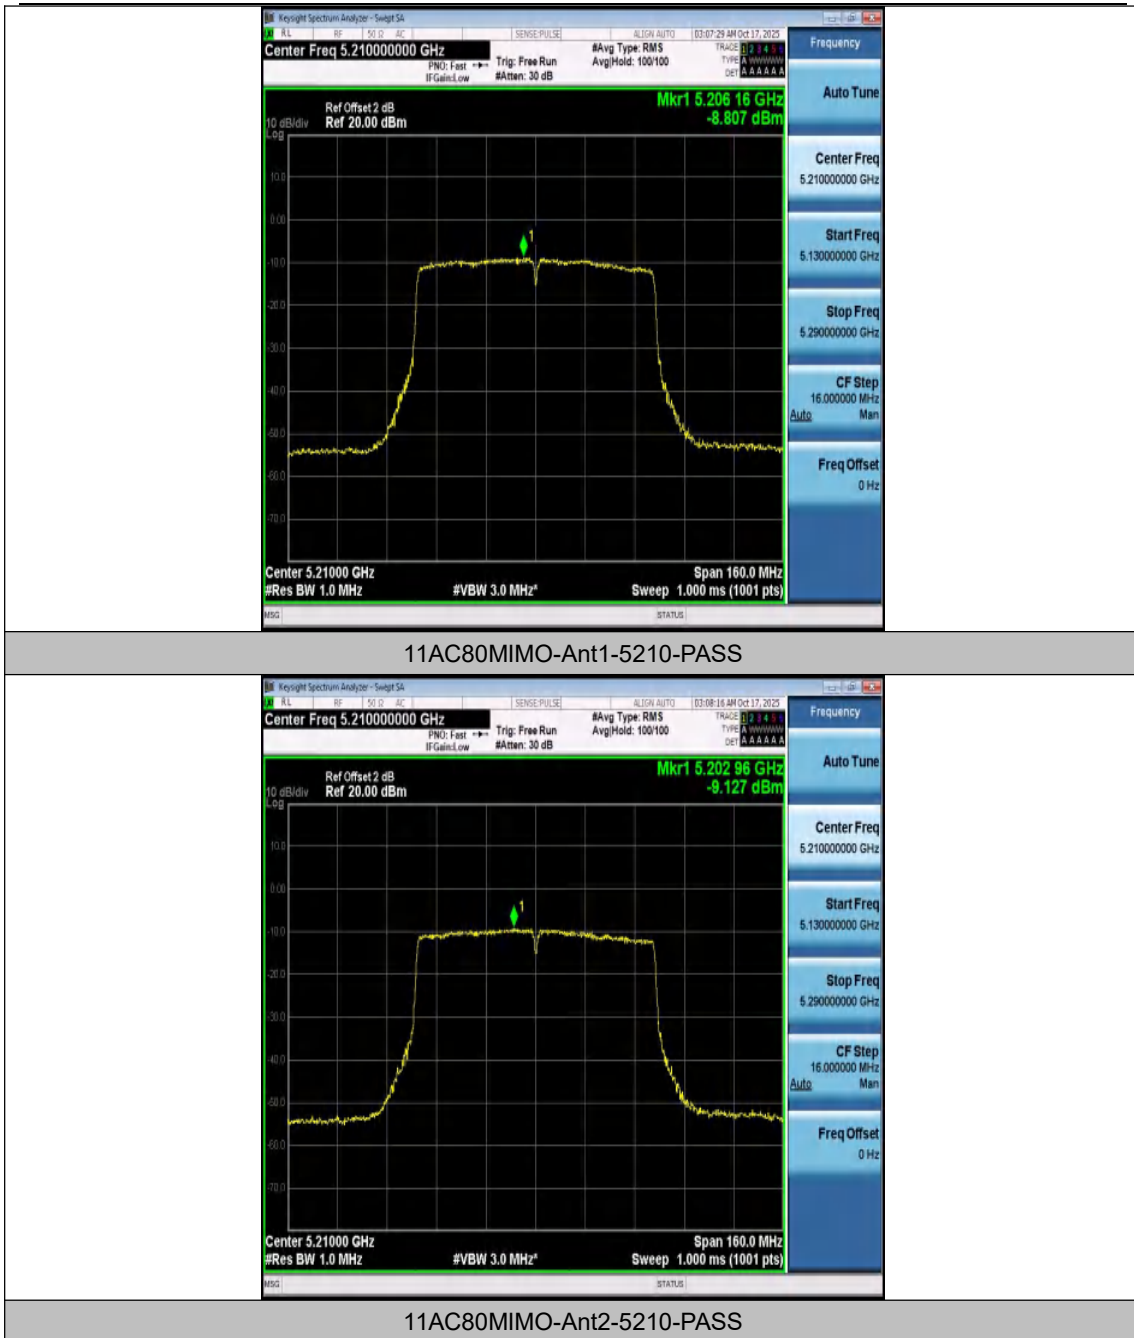

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

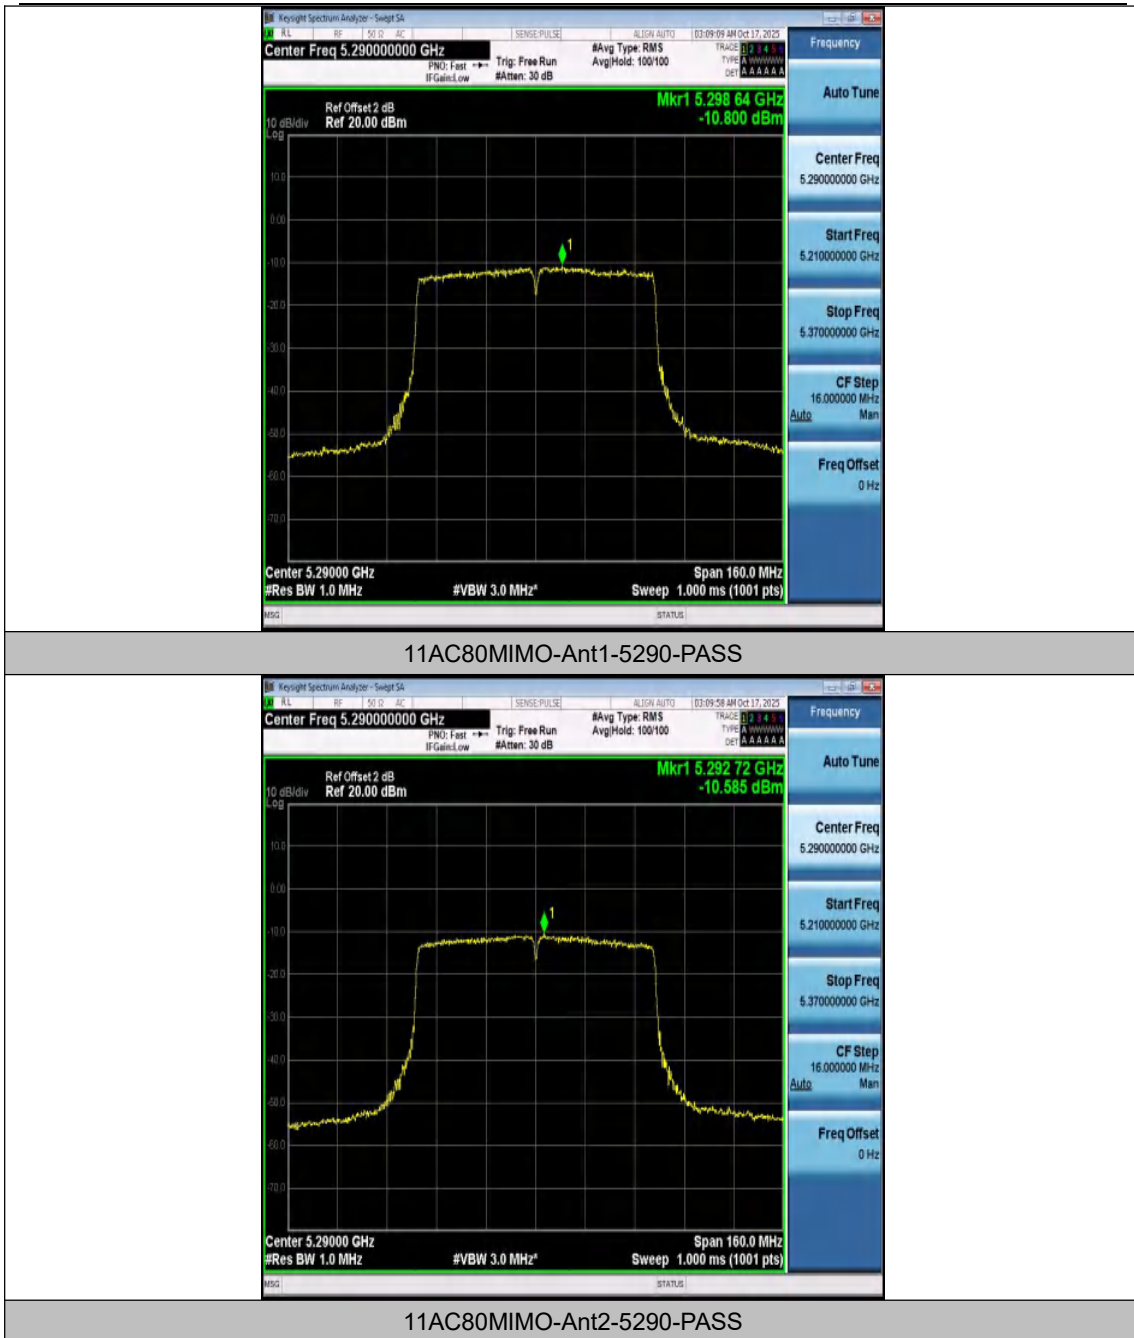

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

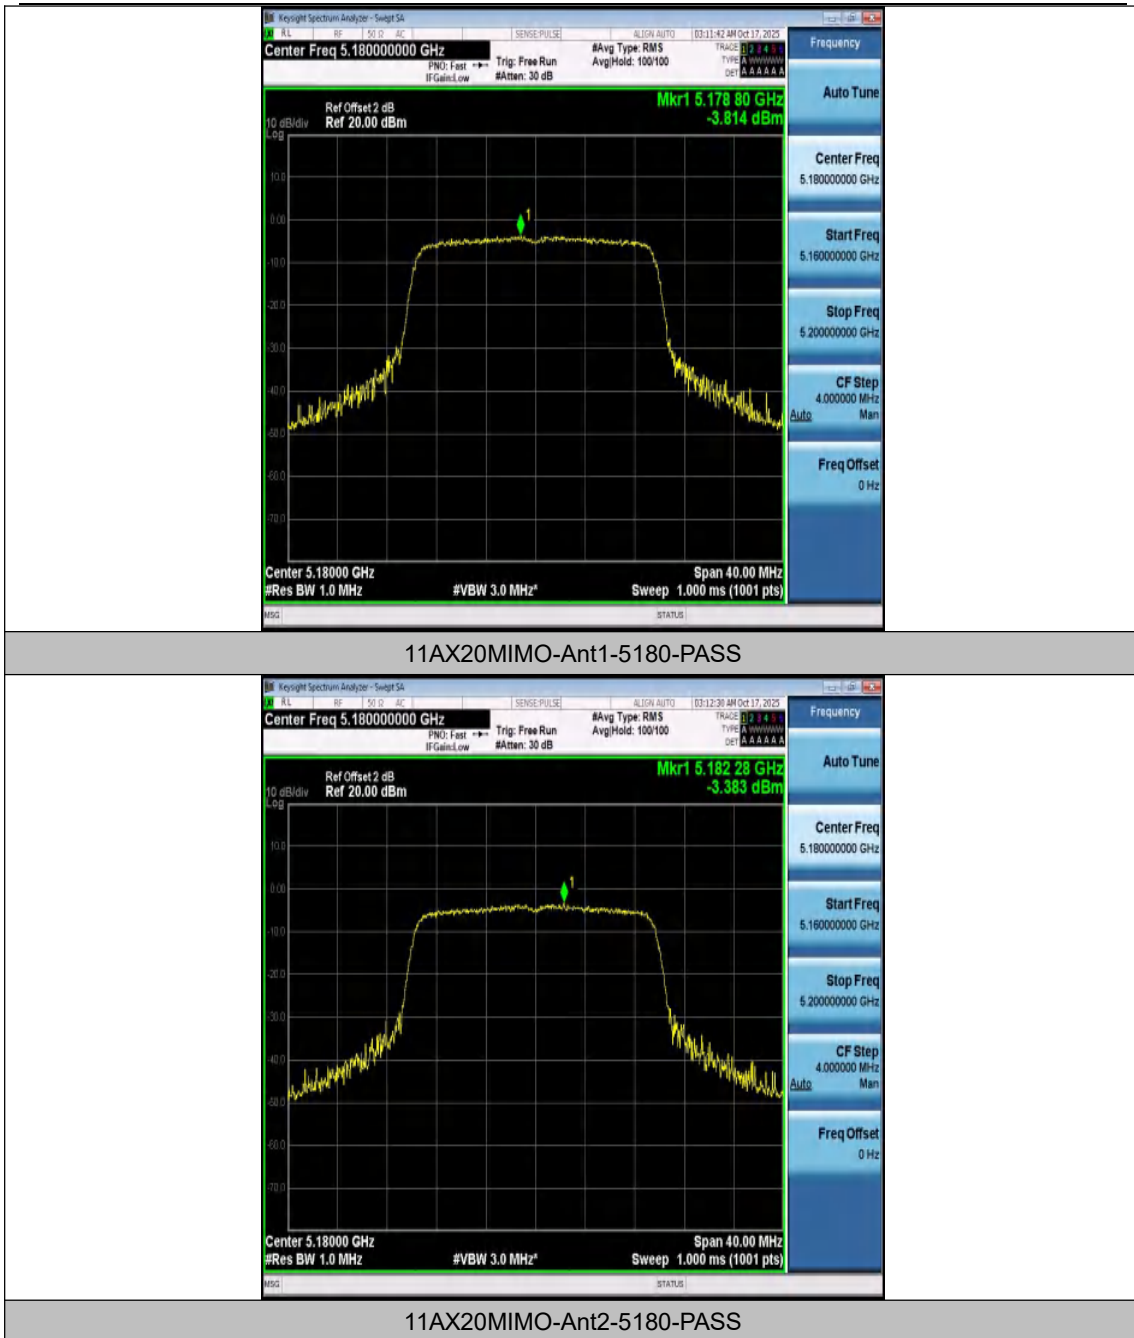

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

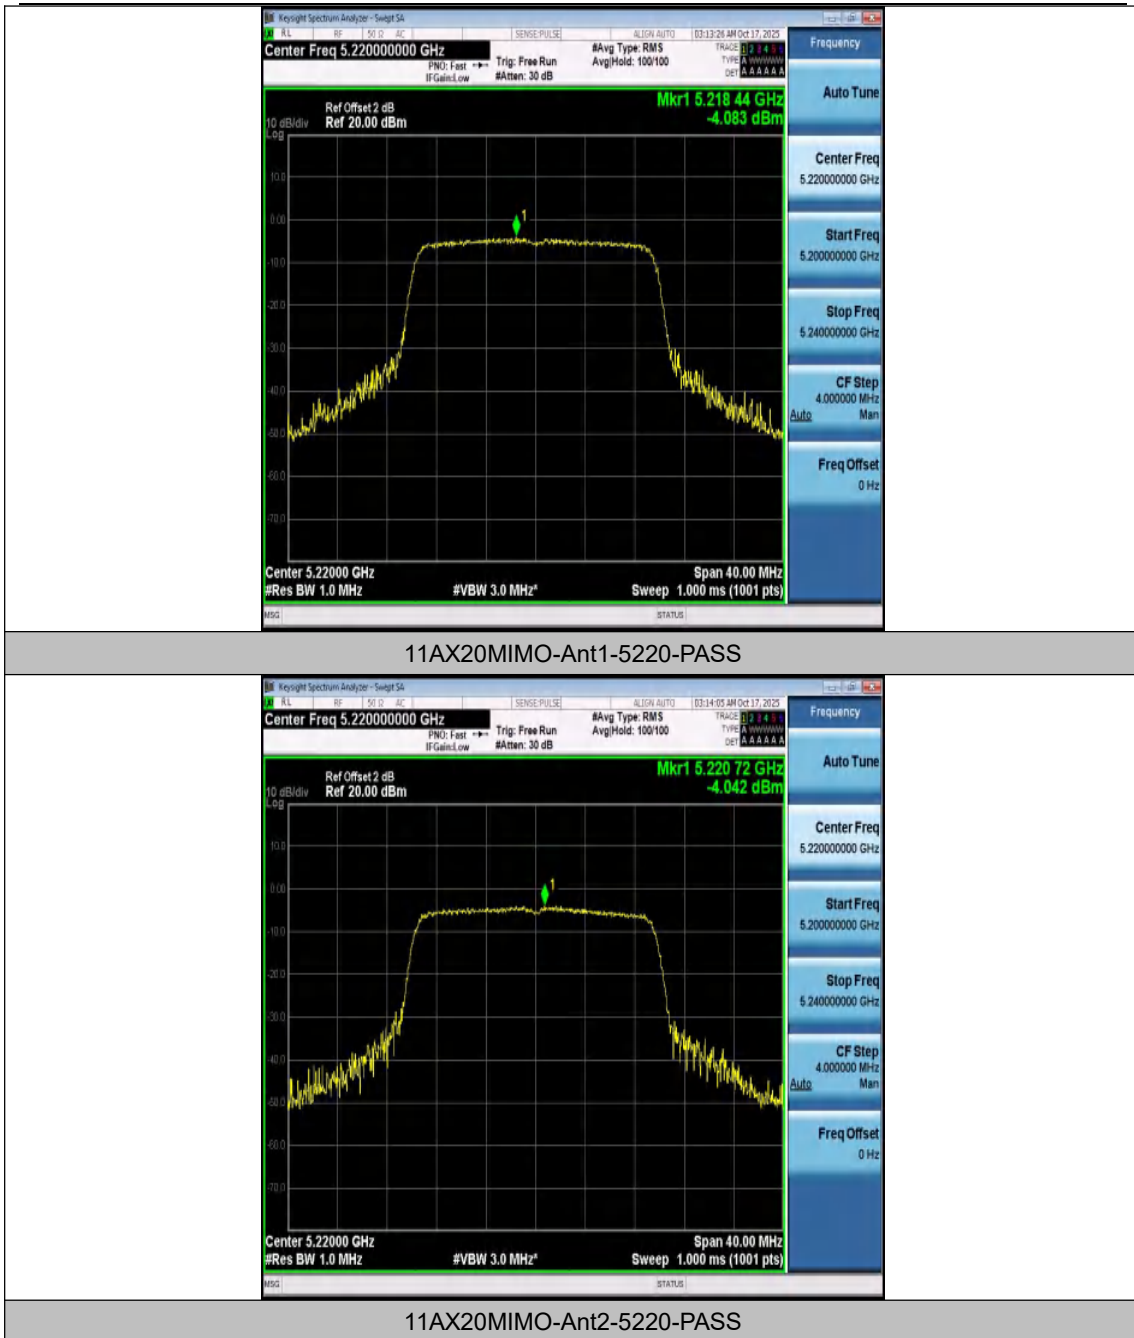


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

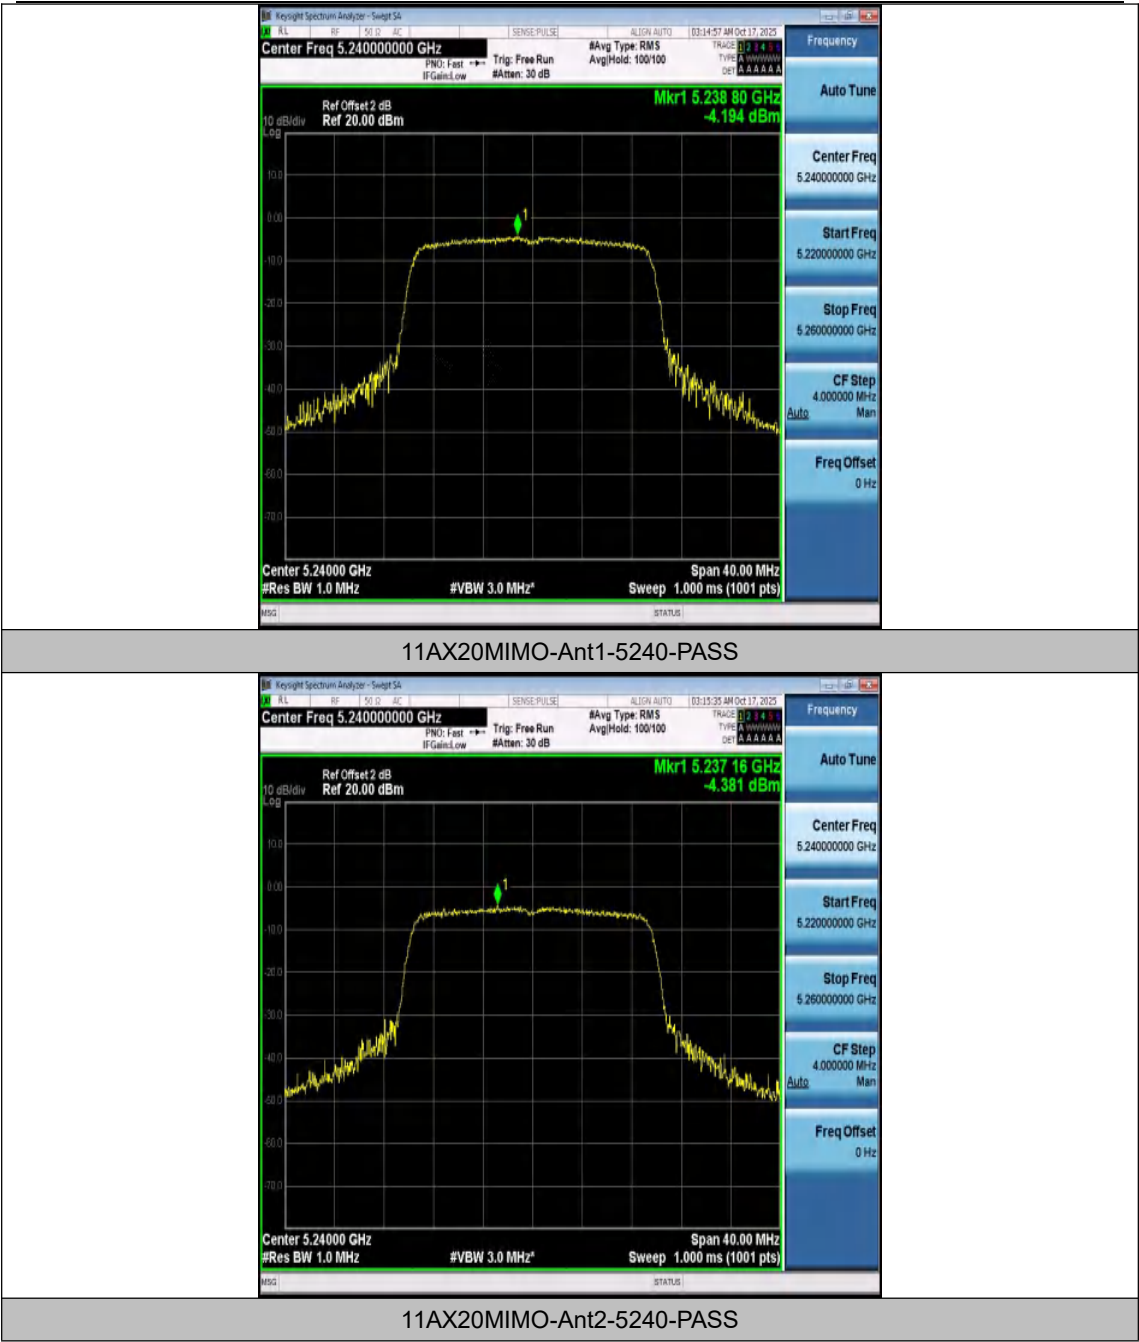


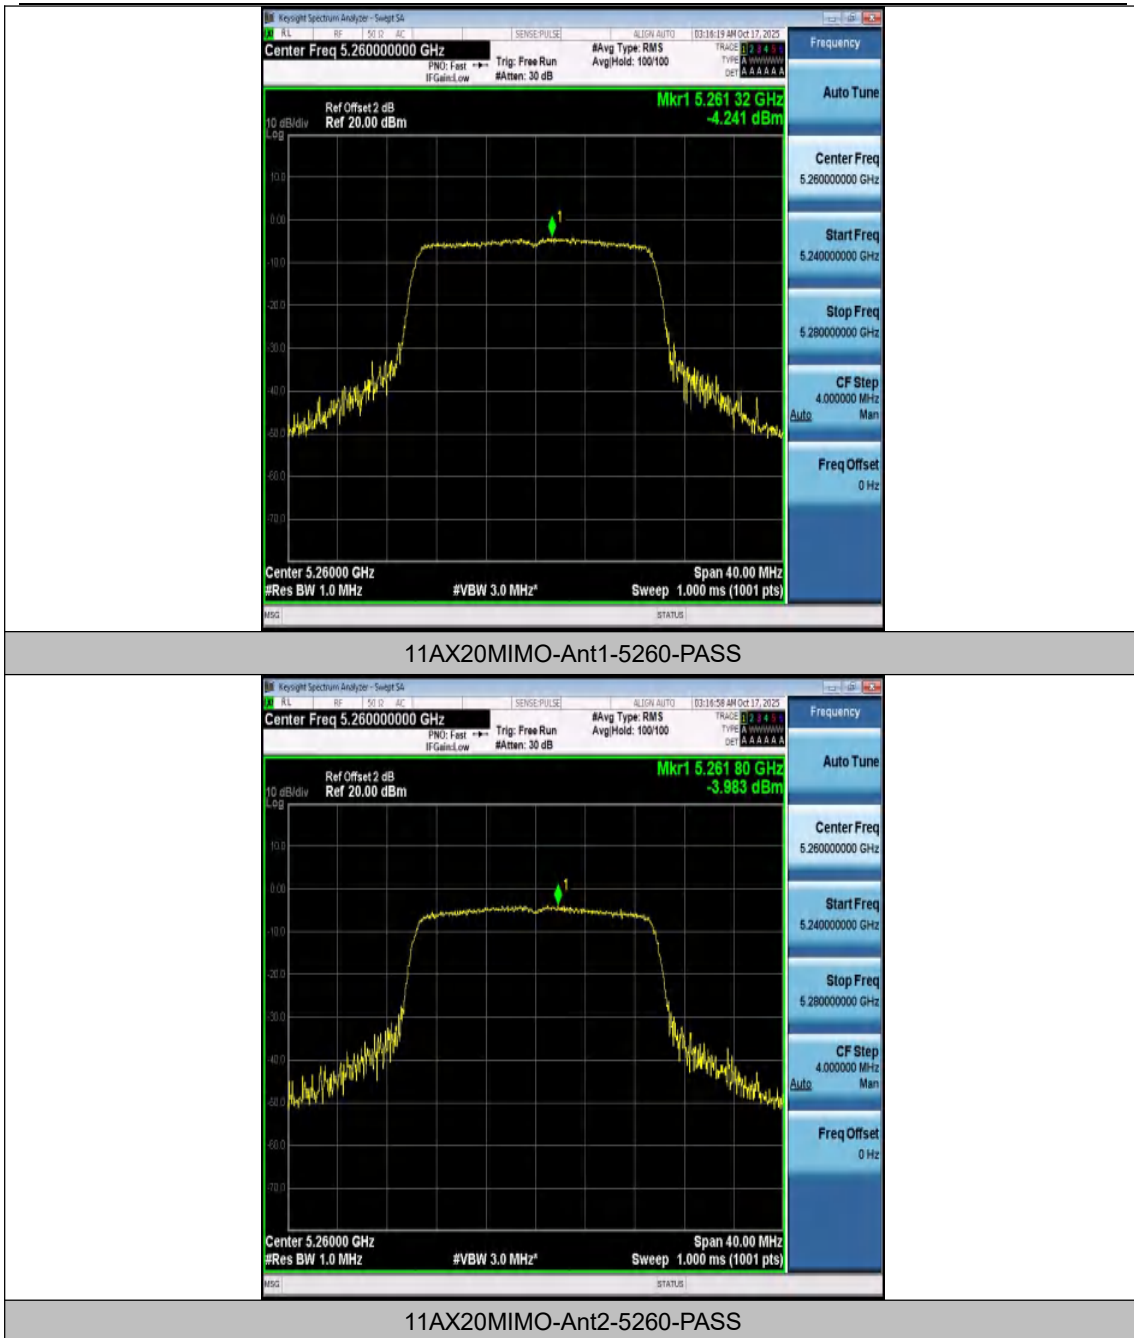

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

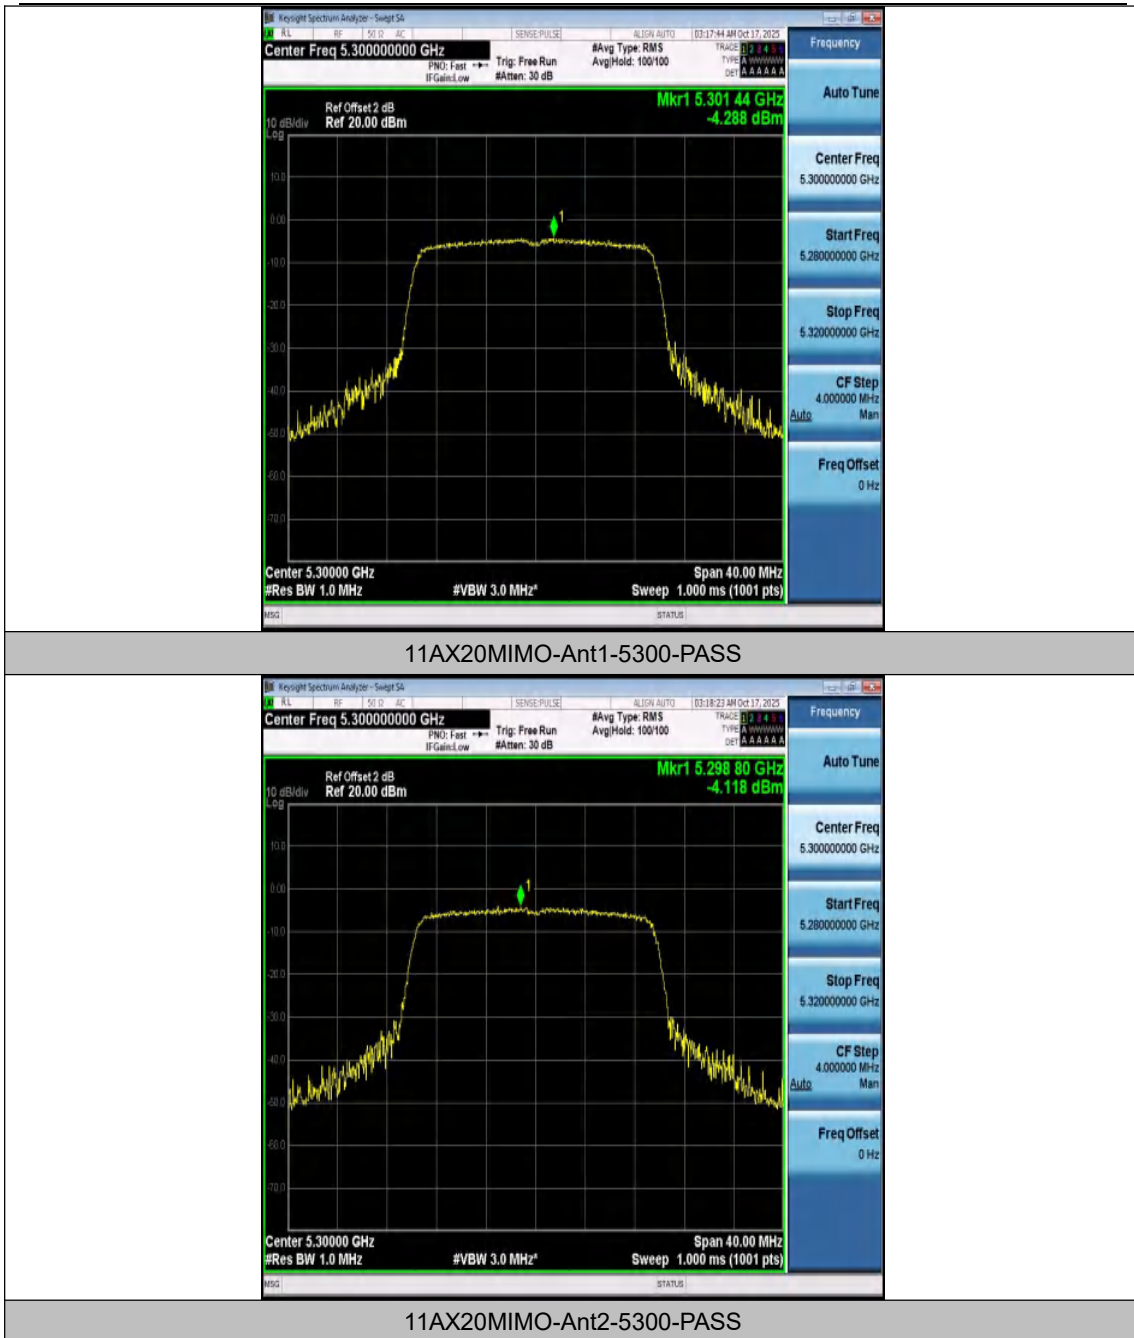

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

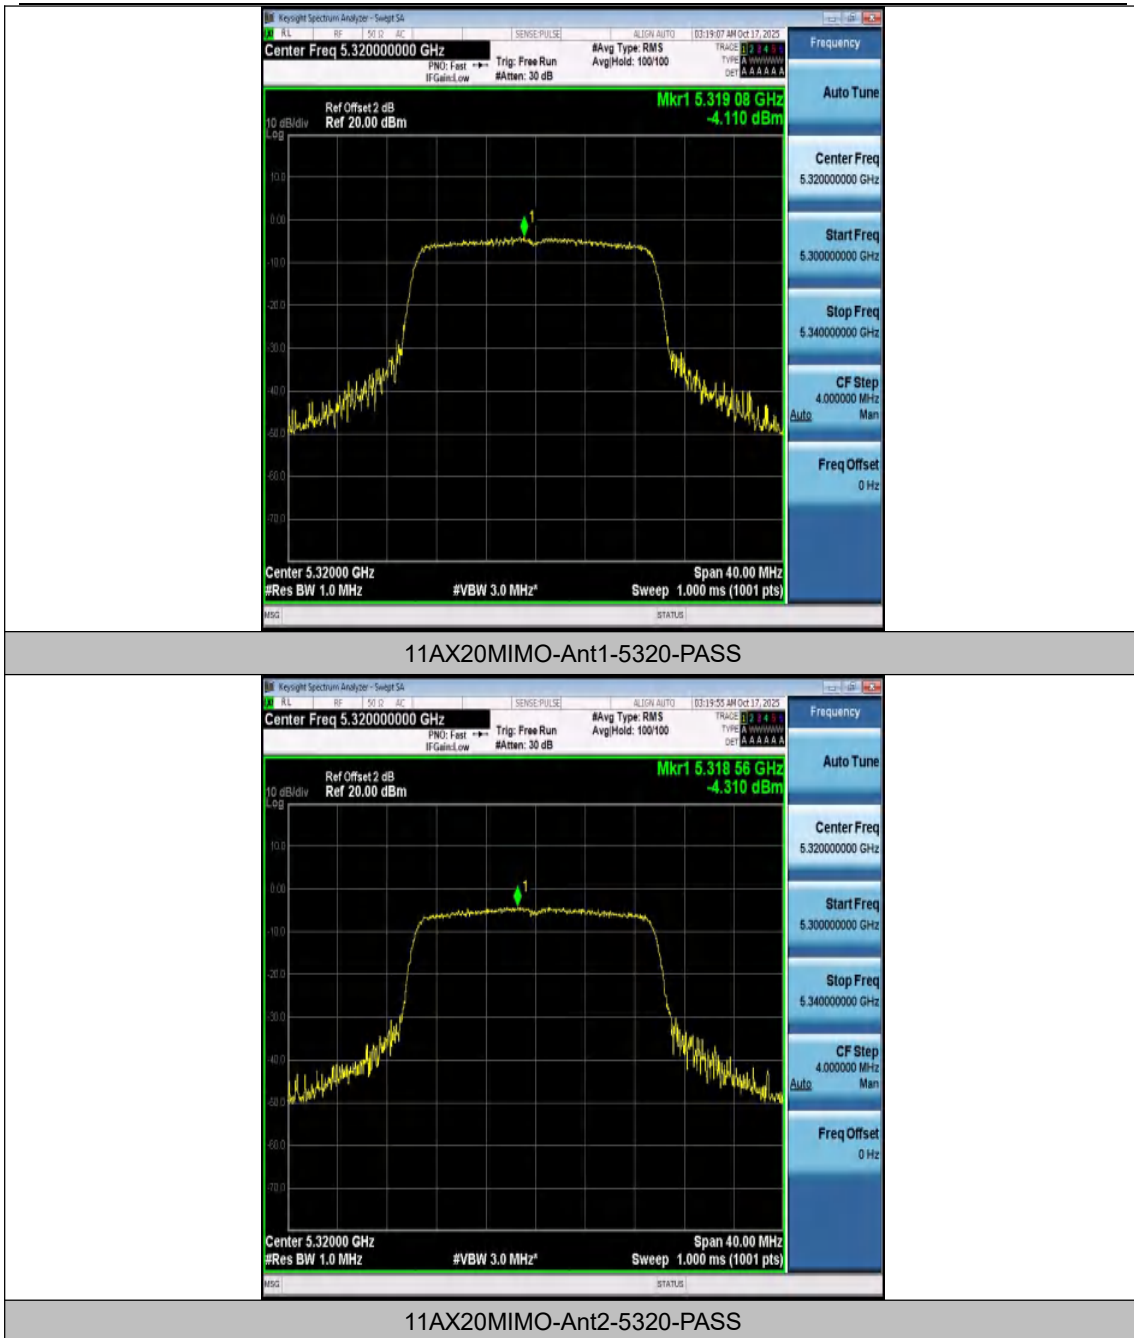

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

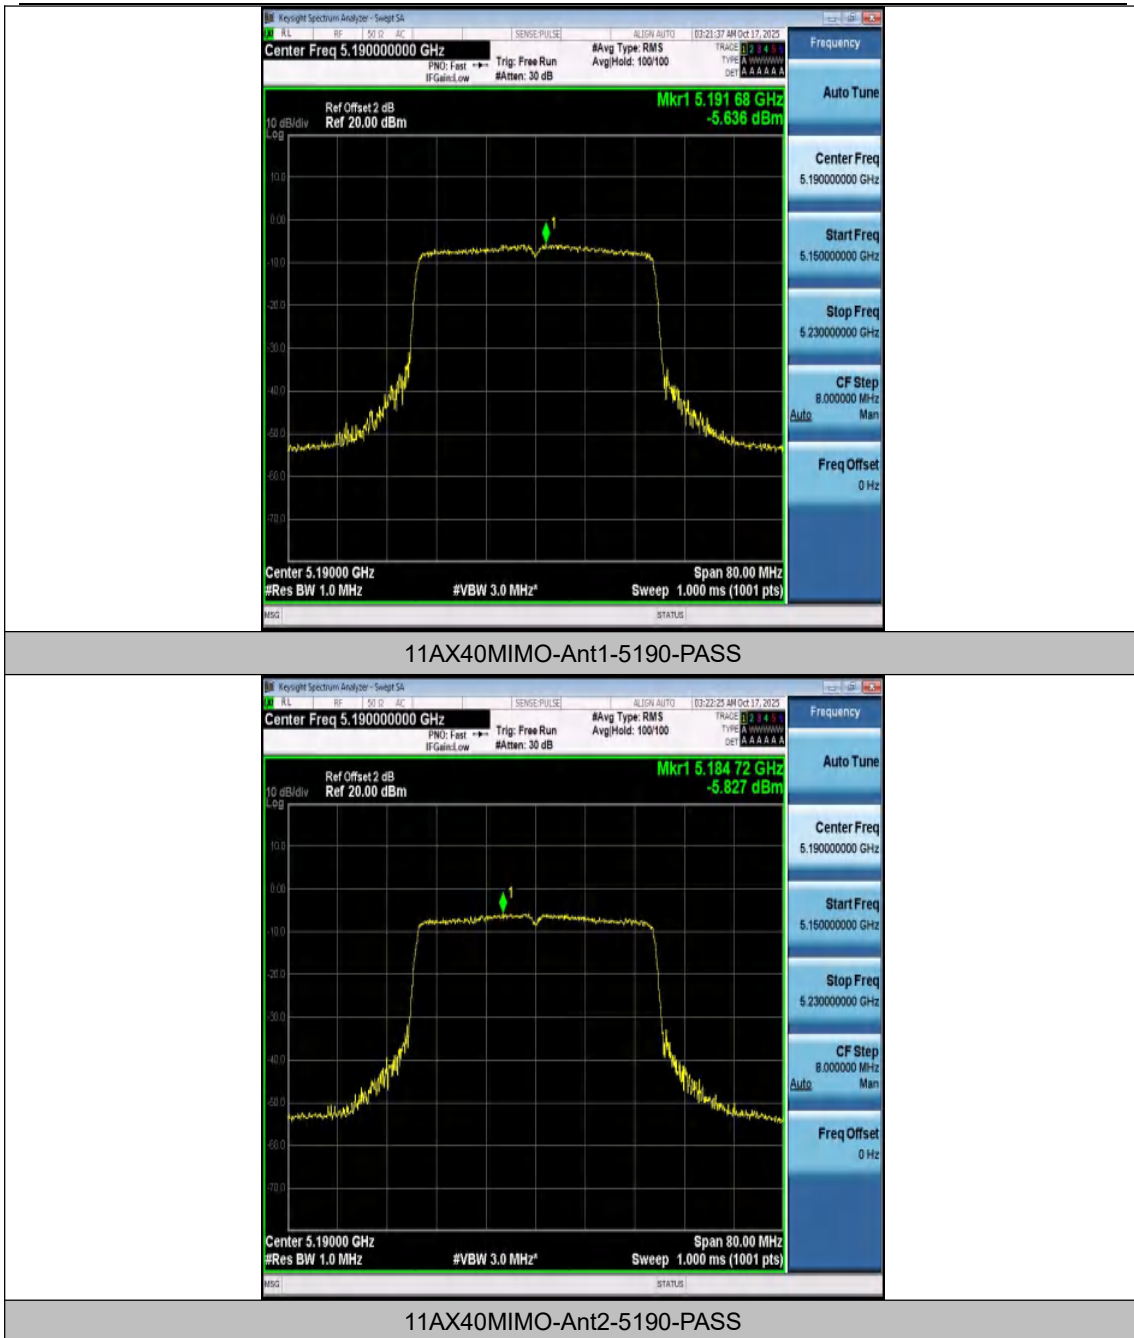

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

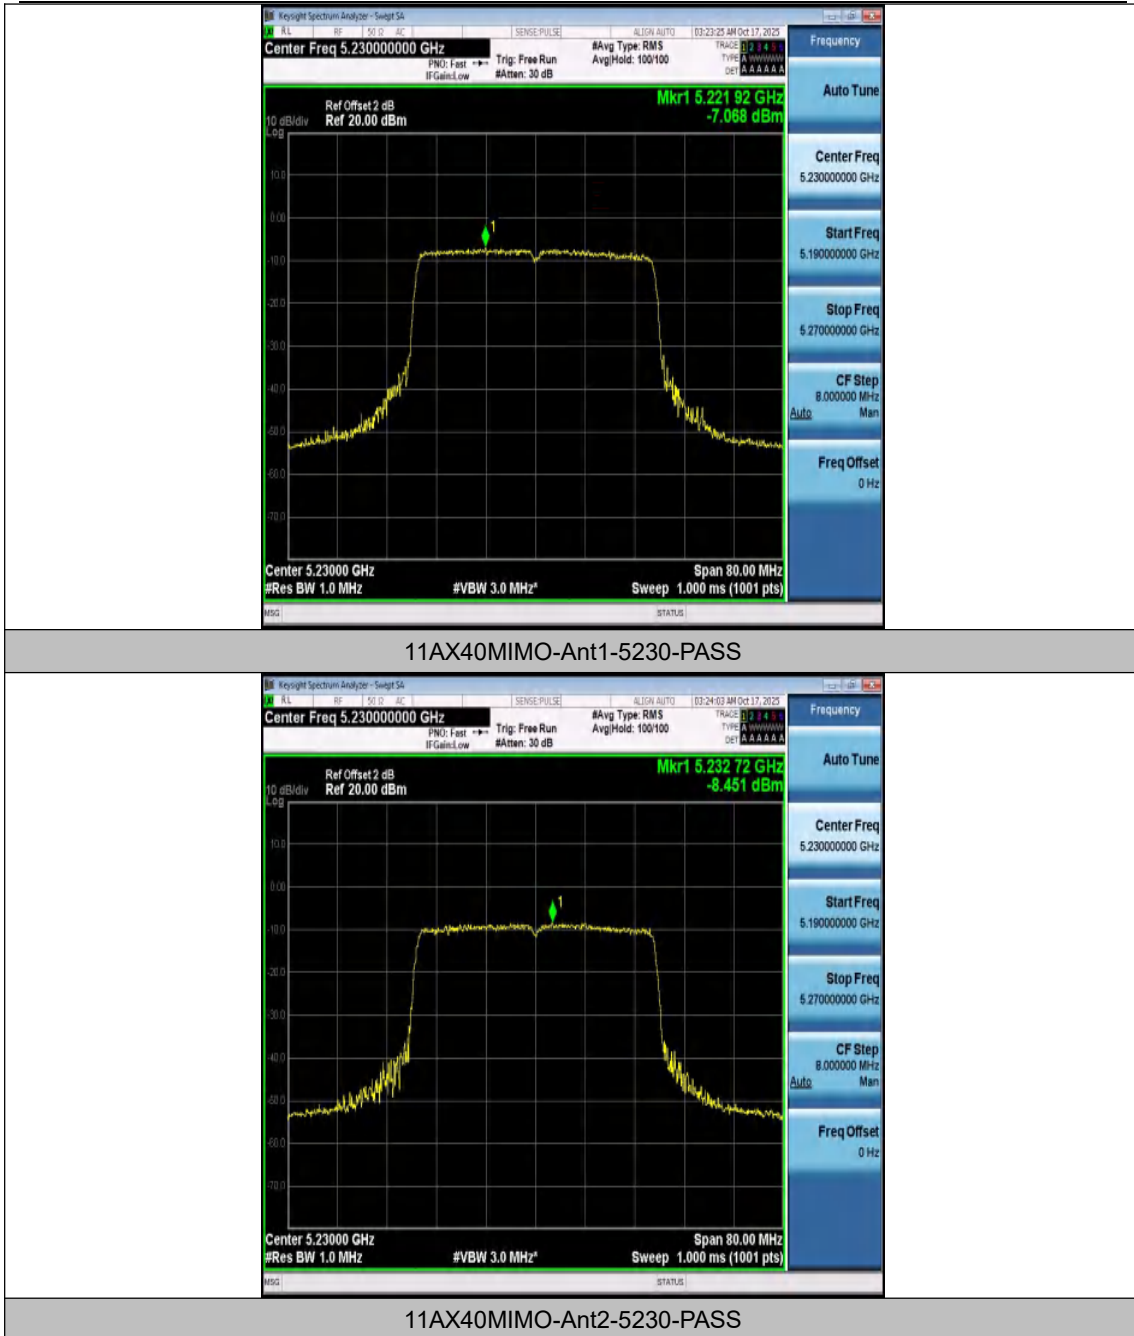

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

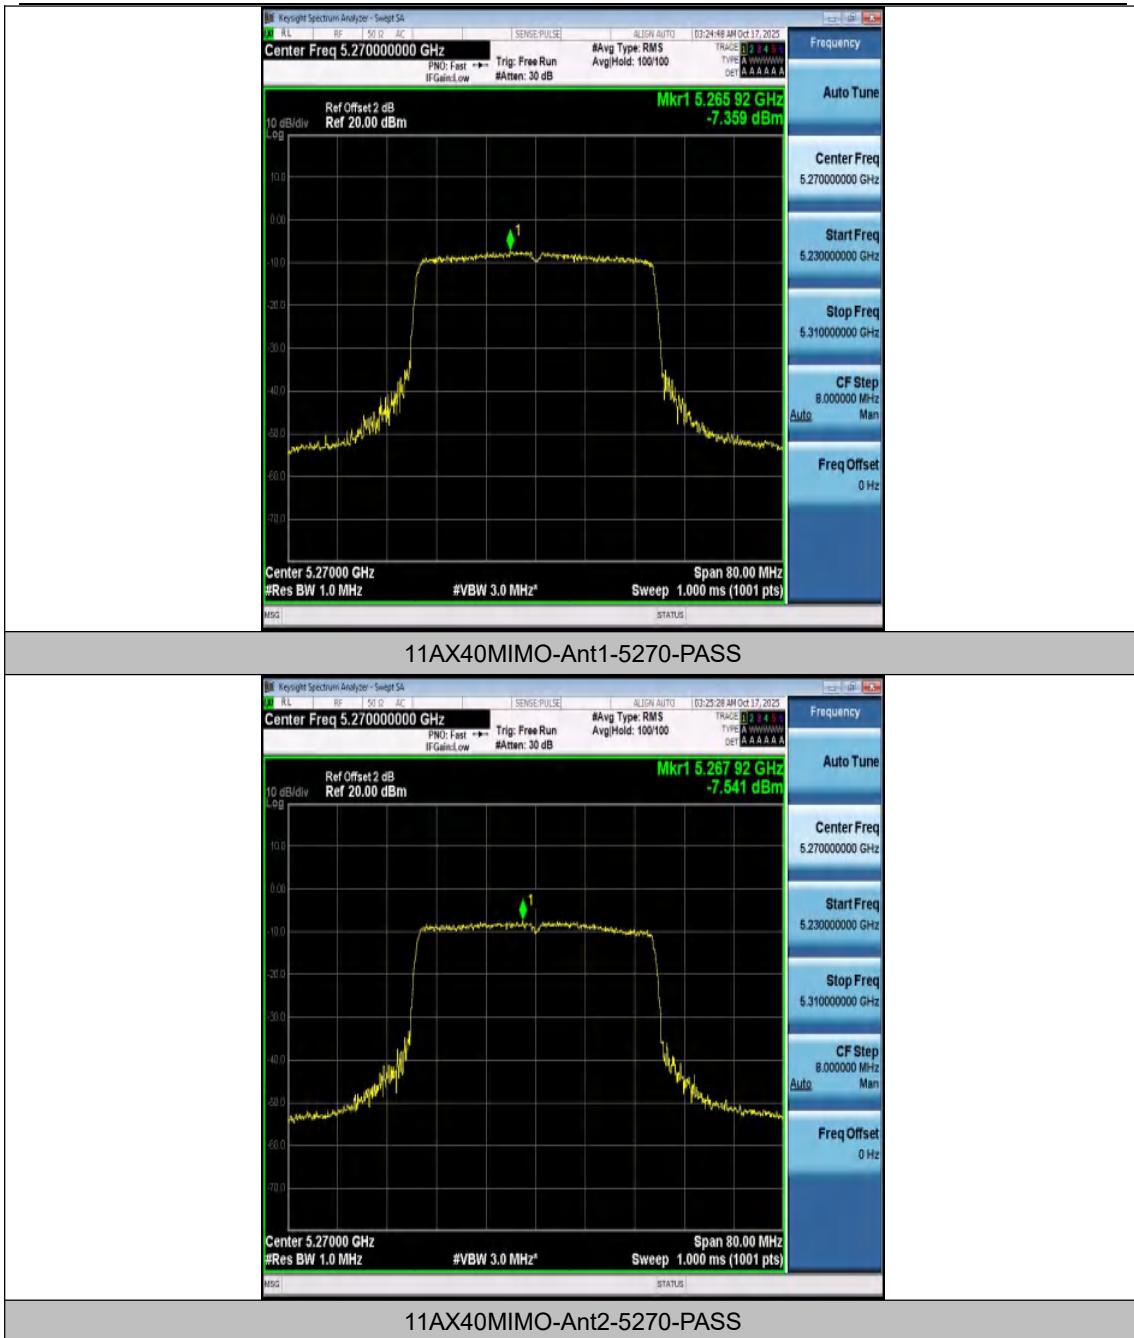

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

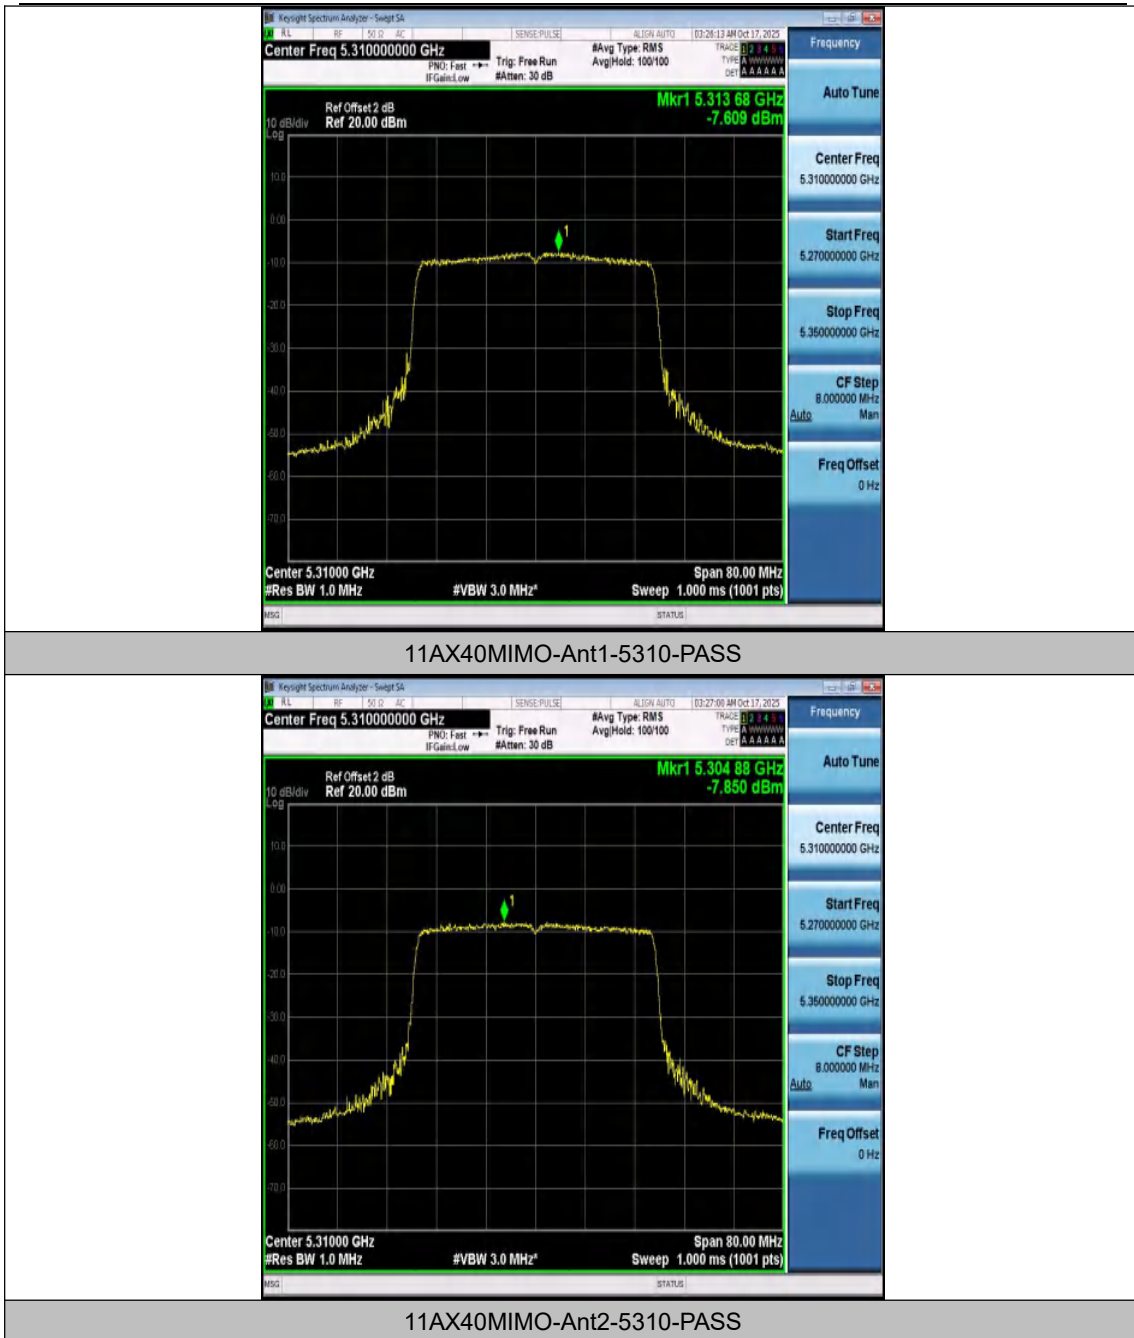

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

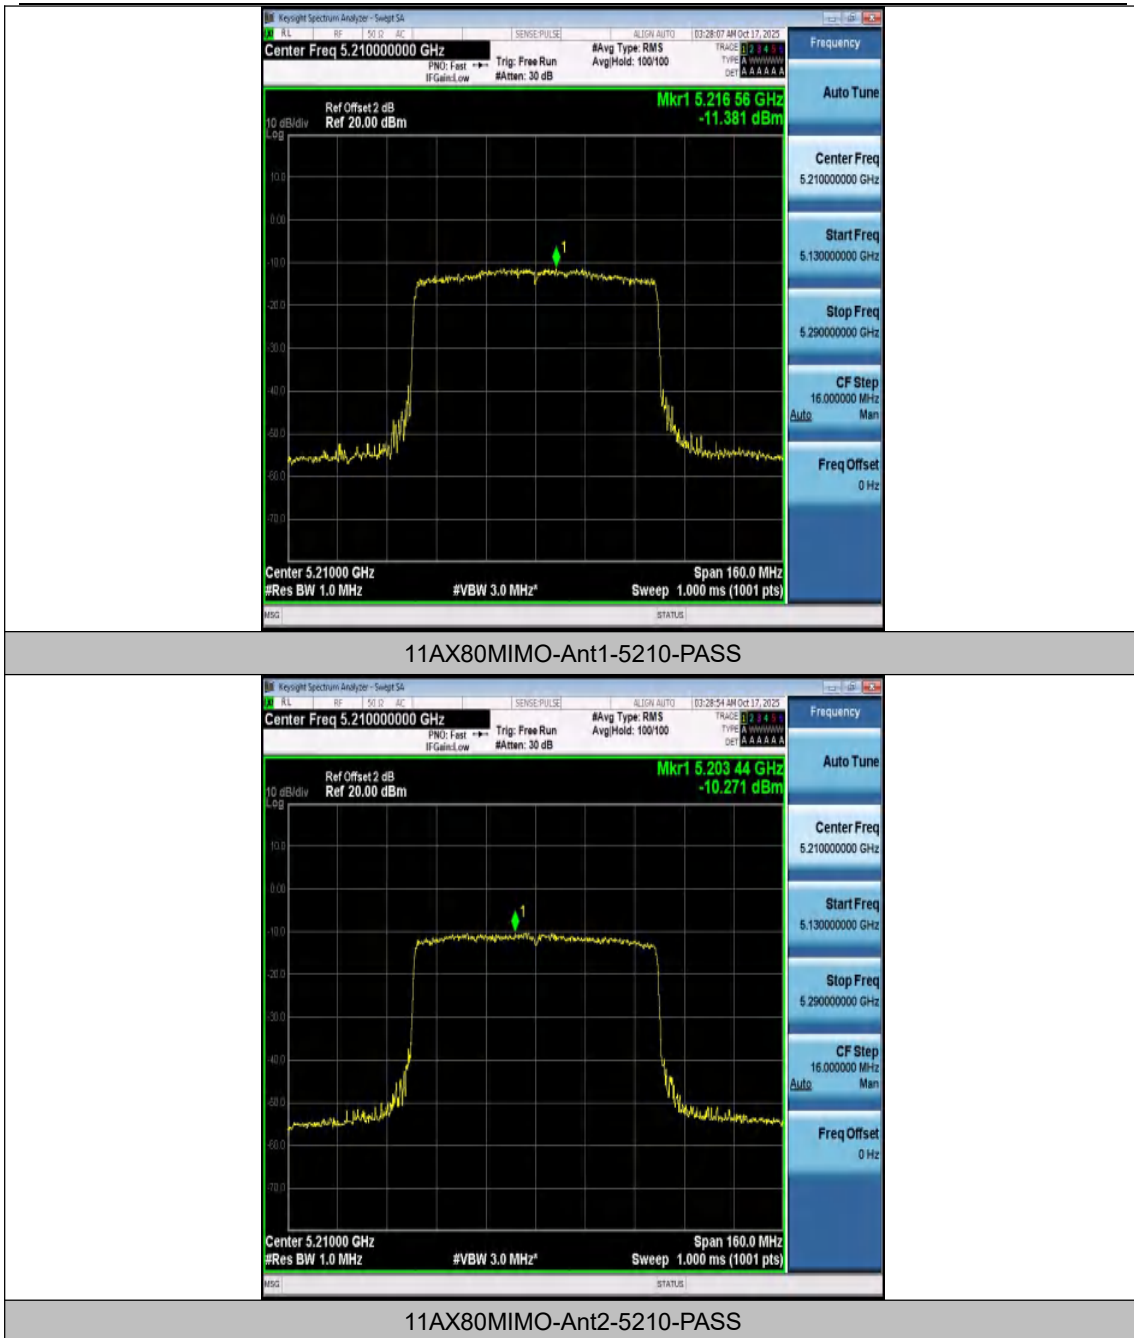

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

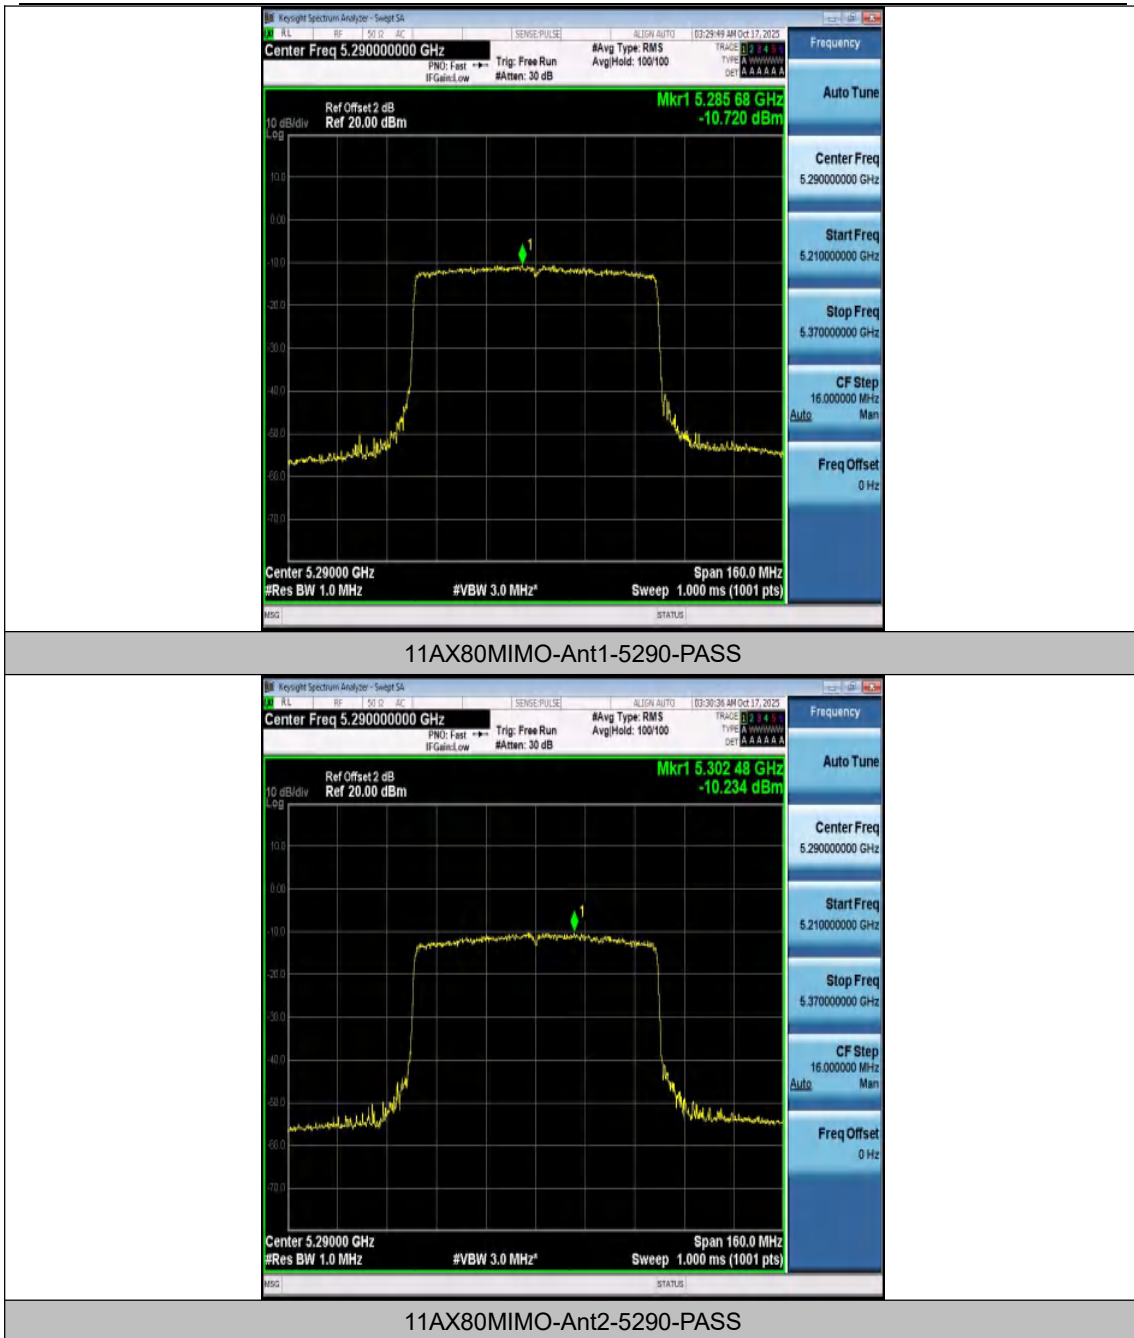

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix E: Band edge measurements

Test Result B1/2

Test Mode	Antenna	ChName	Frequency [MHz]	Reading Result[dBm]	Gain [dBi]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5180	-43.03	3.39	-39.64	≤-27	PASS
11A	Ant2	Low	5180	-44.19	3.39	-40.80	≤-27	PASS
11A	Ant1	High	5320	-44.31	3.39	-40.92	≤-27	PASS
11A	Ant2	High	5320	-45.09	3.39	-41.70	≤-27	PASS
11N20MIMO	Ant1	Low	5180	-44.74	3.39	-41.35	≤-27	PASS
11N20MIMO	Ant2	Low	5180	-43.59	3.39	-40.20	≤-27	PASS
11N20MIMO	Ant1	High	5320	-43.33	3.39	-39.94	≤-27	PASS
11N20MIMO	Ant2	High	5320	-42.6	3.39	-39.21	≤-27	PASS
11N40MIMO	Ant1	Low	5190	-39.85	3.39	-36.46	≤-27	PASS
11N40MIMO	Ant2	Low	5190	-44.17	3.39	-40.78	≤-27	PASS
11N40MIMO	Ant1	High	5310	-39.97	3.39	-36.58	≤-27	PASS
11N40MIMO	Ant2	High	5310	-40.97	3.39	-37.58	≤-27	PASS
11AC20MIMO	Ant1	Low	5180	-43.77	3.39	-40.38	≤-27	PASS
11AC20MIMO	Ant2	Low	5180	-43.61	3.39	-40.22	≤-27	PASS
11AC20MIMO	Ant1	High	5320	-43.72	3.39	-40.33	≤-27	PASS
11AC20MIMO	Ant2	High	5320	-44.12	3.39	-40.73	≤-27	PASS
11AC40MIMO	Ant1	Low	5190	-39.66	3.39	-36.27	≤-27	PASS
11AC40MIMO	Ant2	Low	5190	-44.16	3.39	-40.77	≤-27	PASS
11AC40MIMO	Ant1	High	5310	-41.14	3.39	-37.75	≤-27	PASS
11AC40MIMO	Ant2	High	5310	-38.21	3.39	-34.82	≤-27	PASS
11AC80MIMO	Ant1	Low	5210	-42.13	3.39	-38.74	≤-27	PASS
11AC80MIMO	Ant2	Low	5210	-41.22	3.39	-37.83	≤-27	PASS
11AC80MIMO	Ant1	High	5290	-38.04	3.39	-34.65	≤-27	PASS
11AC80MIMO	Ant2	High	5290	-39.37	3.39	-35.98	≤-27	PASS
11AX20MIMO	Ant1	Low	5180	-43.45	3.39	-40.06	≤-27	PASS
11AX20MIMO	Ant2	Low	5180	-42.55	3.39	-39.16	≤-27	PASS
11AX20MIMO	Ant1	High	5320	-40.64	3.39	-37.25	≤-27	PASS
11AX20MIMO	Ant2	High	5320	-42.76	3.39	-39.37	≤-27	PASS
11AX40MIMO	Ant1	Low	5190	-42.89	3.39	-39.50	≤-27	PASS
11AX40MIMO	Ant2	Low	5190	-41.25	3.39	-37.86	≤-27	PASS
11AX40MIMO	Ant1	High	5310	-42.29	3.39	-38.90	≤-27	PASS
11AX40MIMO	Ant2	High	5310	-40.71	3.39	-37.32	≤-27	PASS
11AX80MIMO	Ant1	Low	5210	-34.09	3.39	-30.70	≤-27	PASS
11AX80MIMO	Ant2	Low	5210	-34.97	3.39	-31.58	≤-27	PASS
11AX80MIMO	Ant1	High	5290	-33.57	3.39	-30.18	≤-27	PASS
11AX80MIMO	Ant2	High	5290	-35.42	3.39	-32.03	≤-27	PASS

Note: 1.The cable loss are compensated in the graph.

Test Graphs B1/2

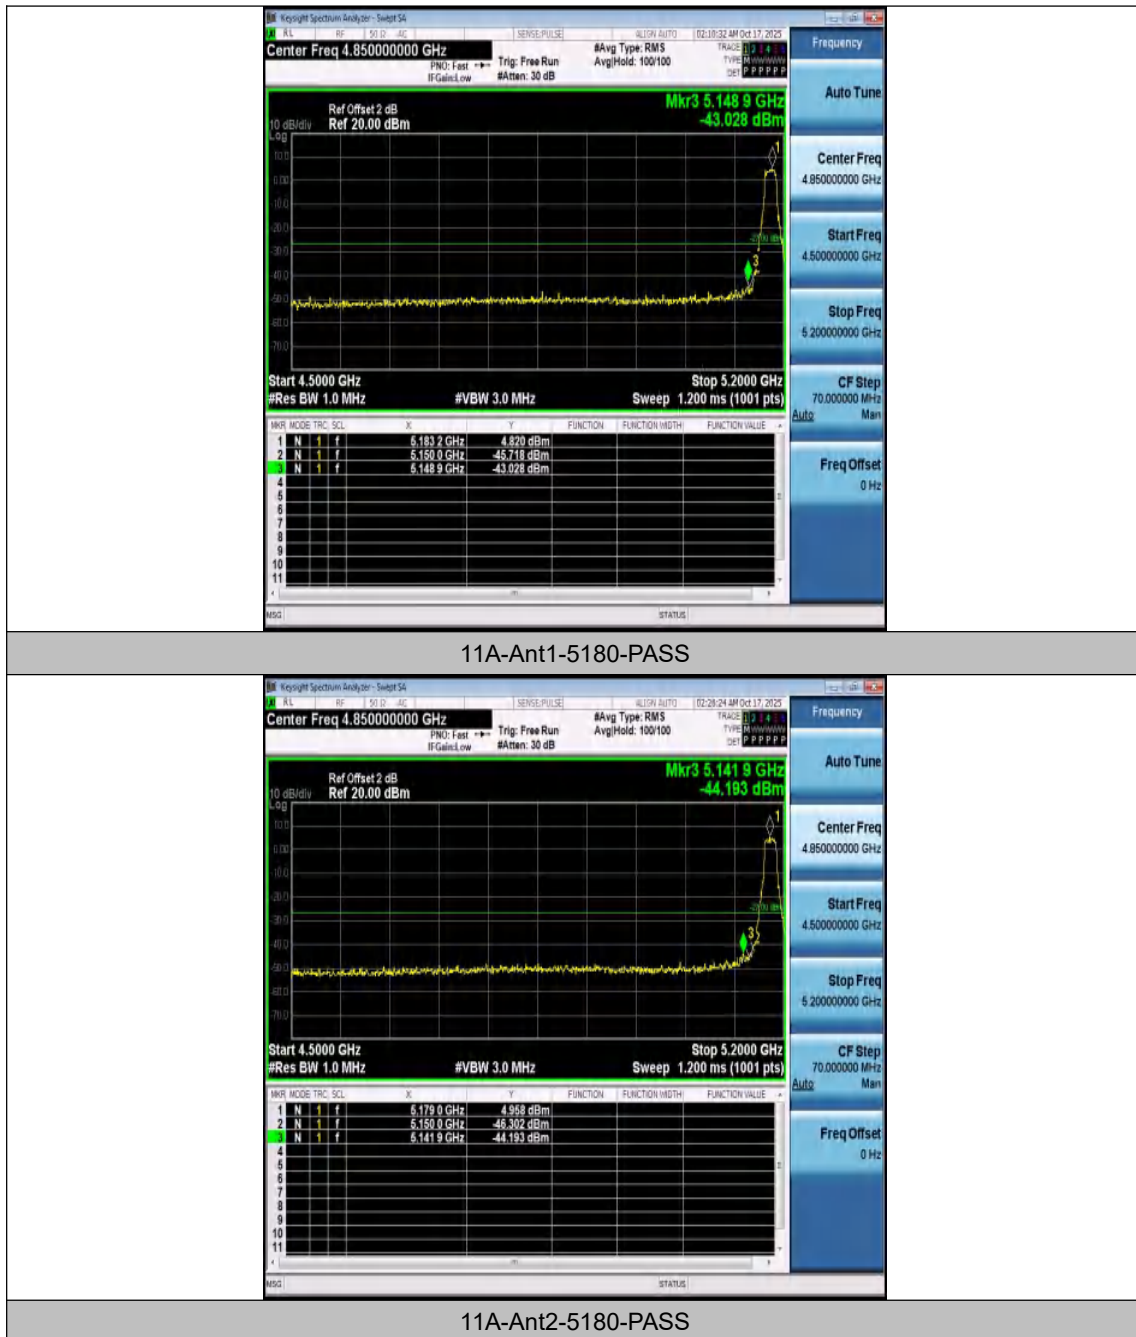

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

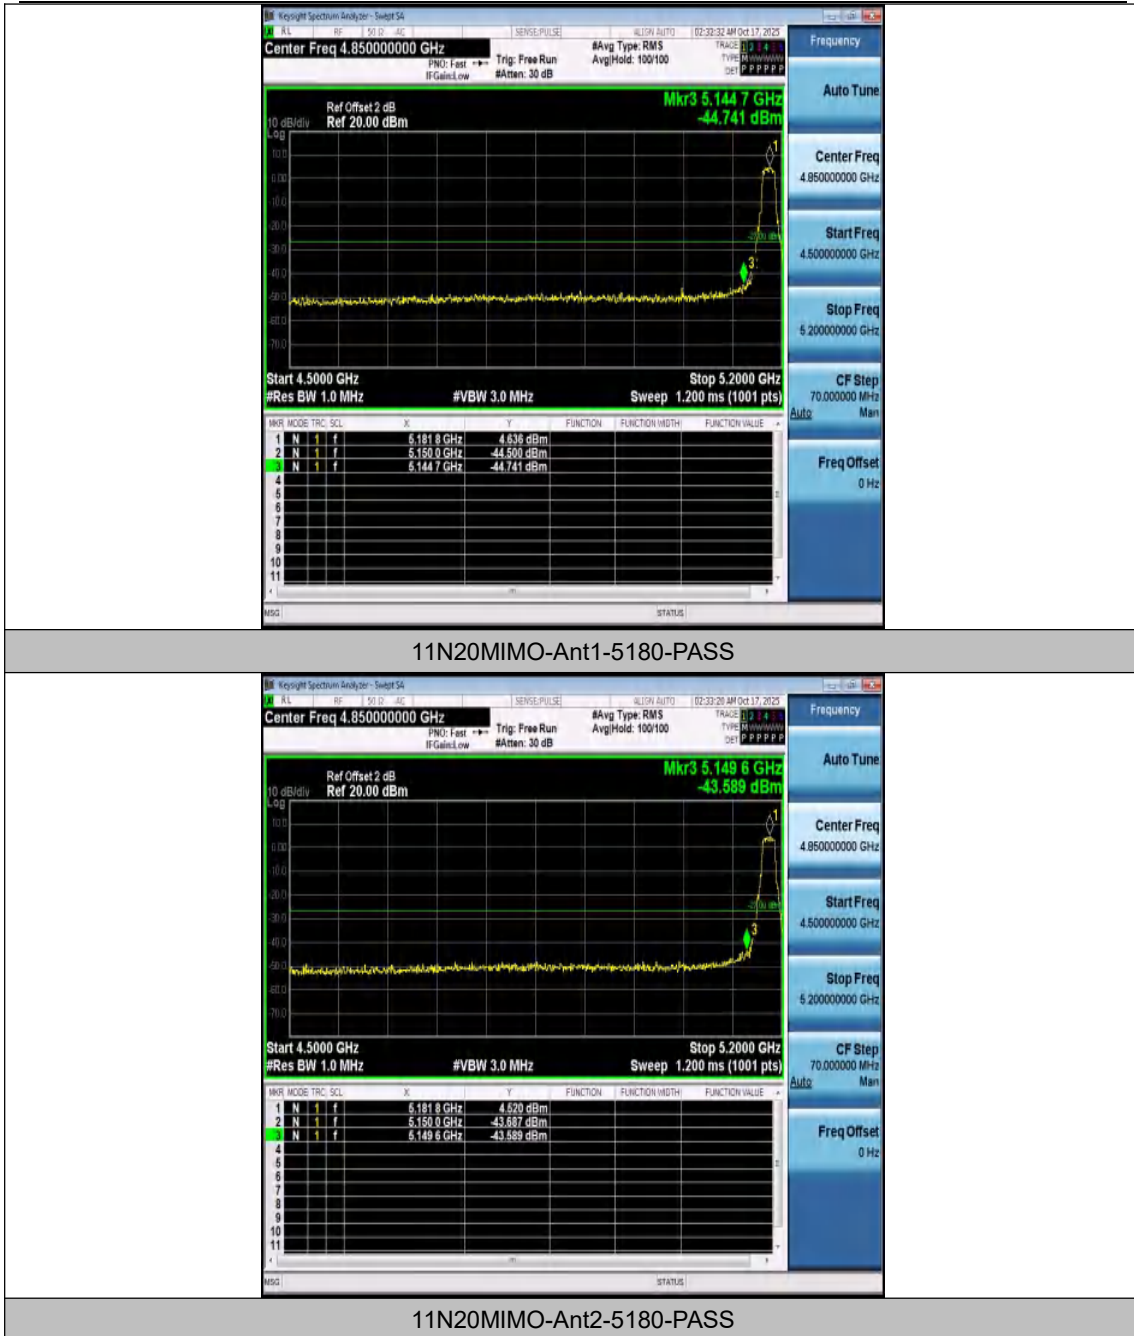



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



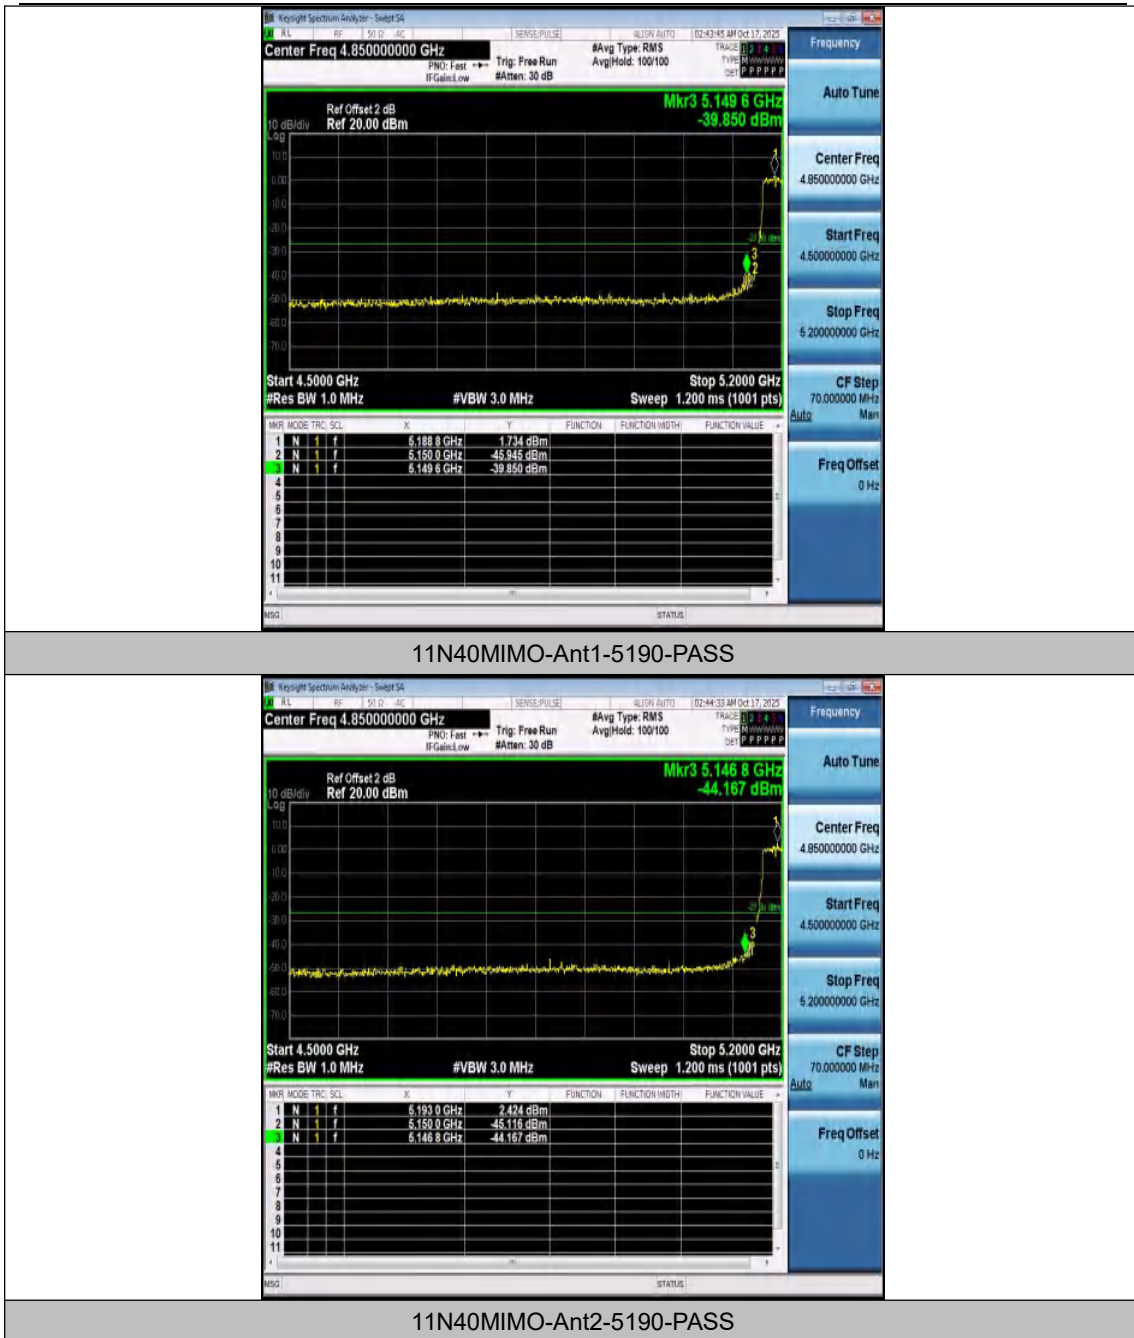

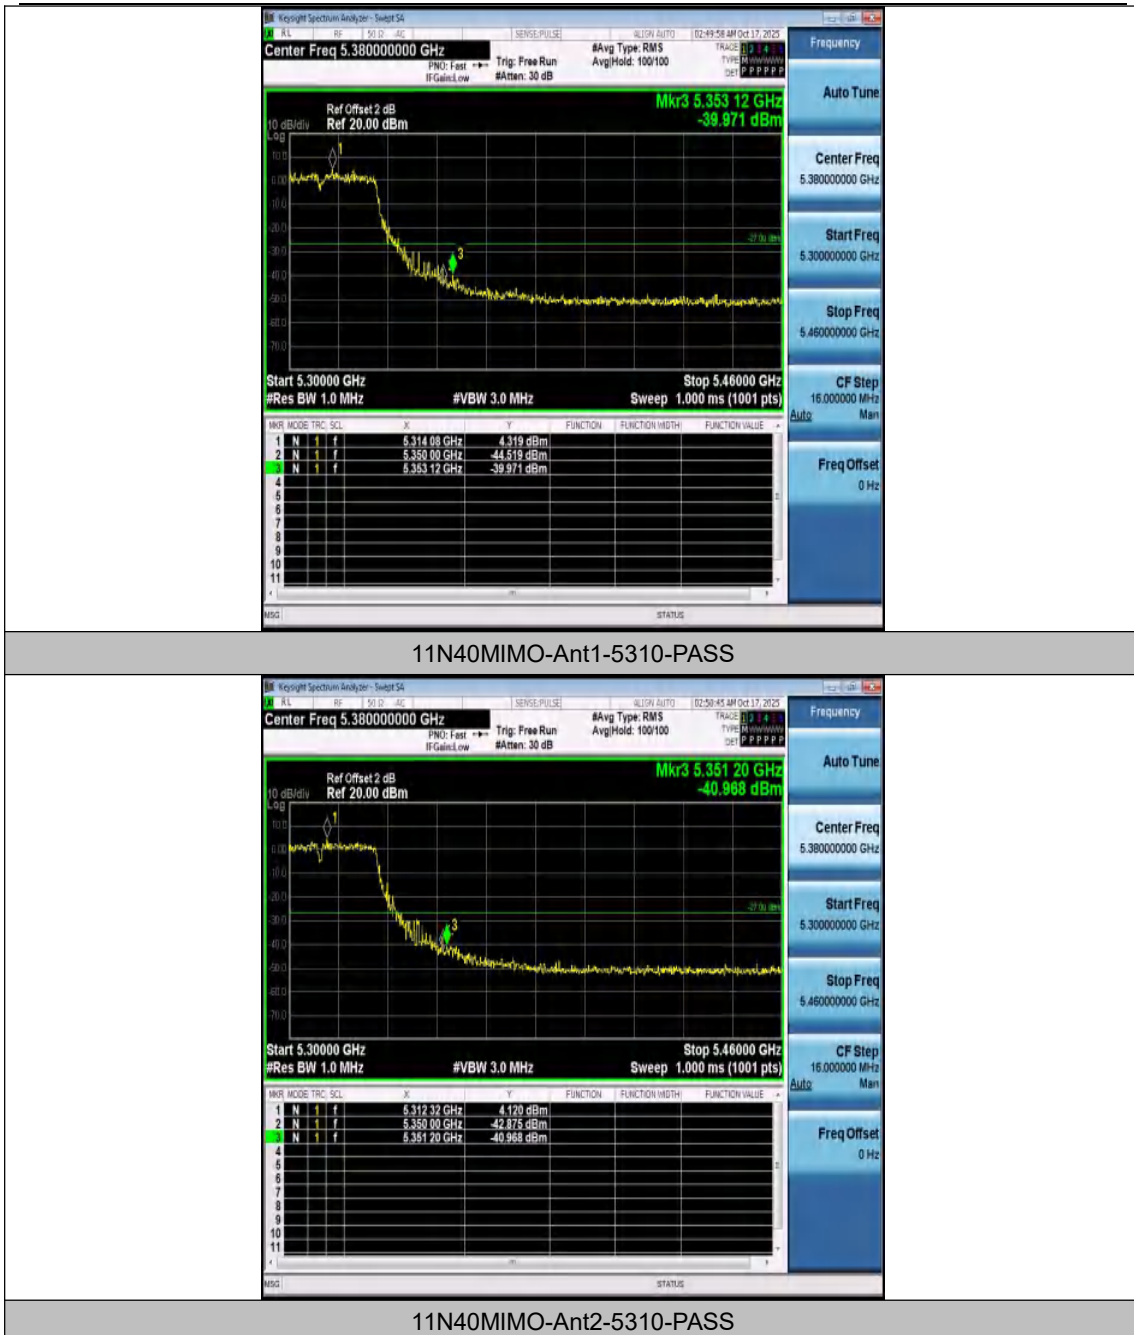

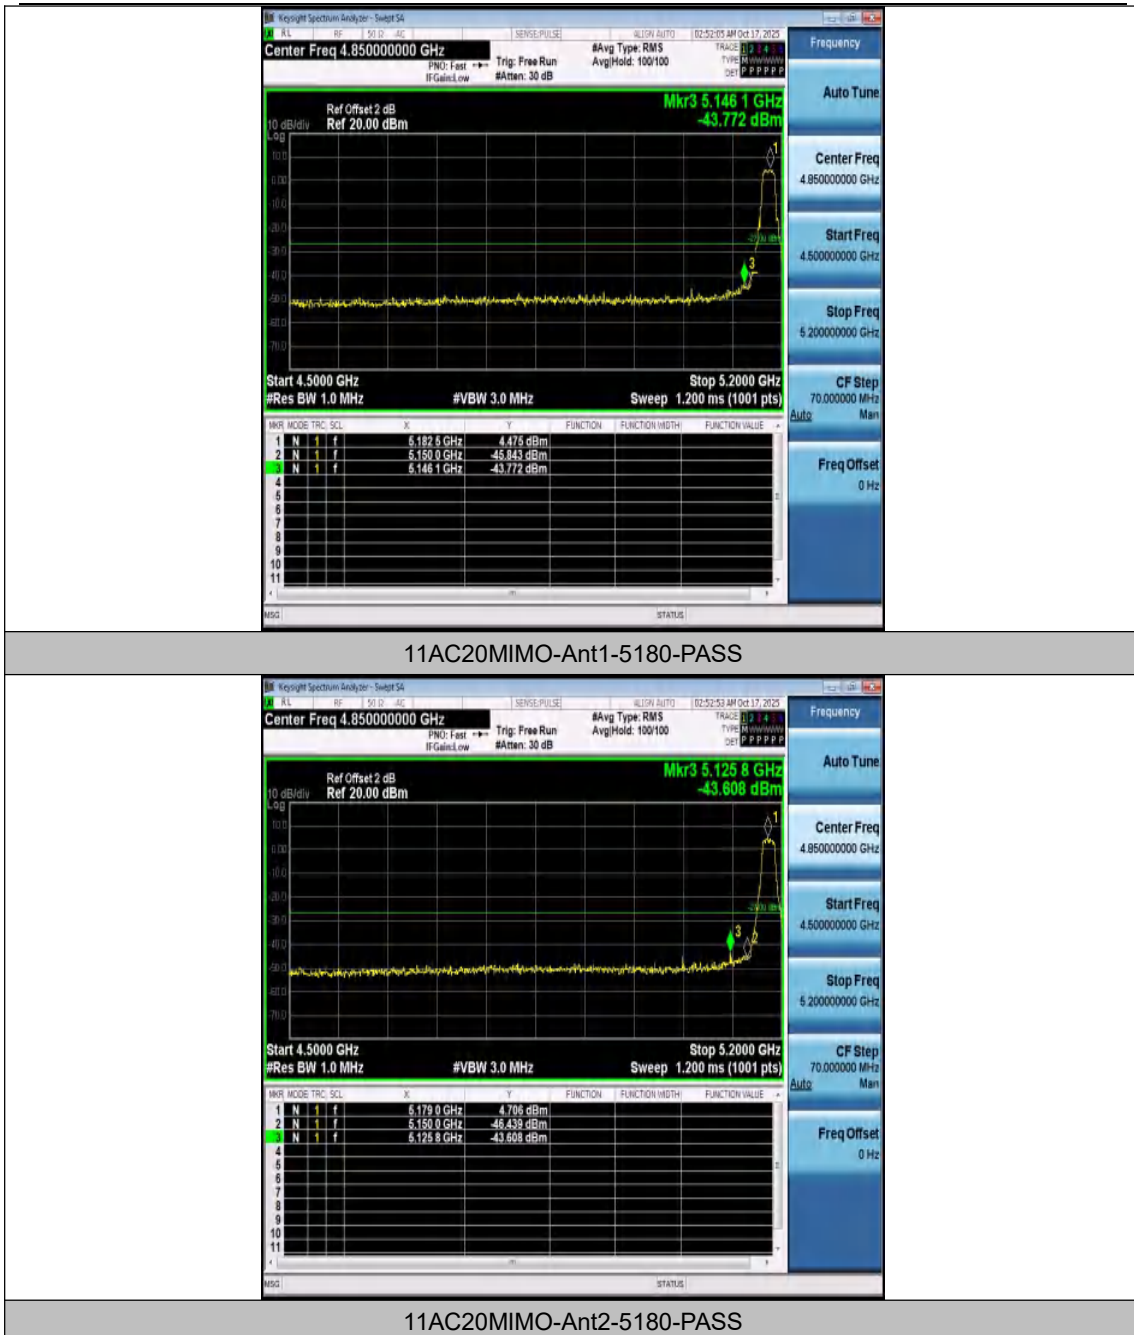





Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

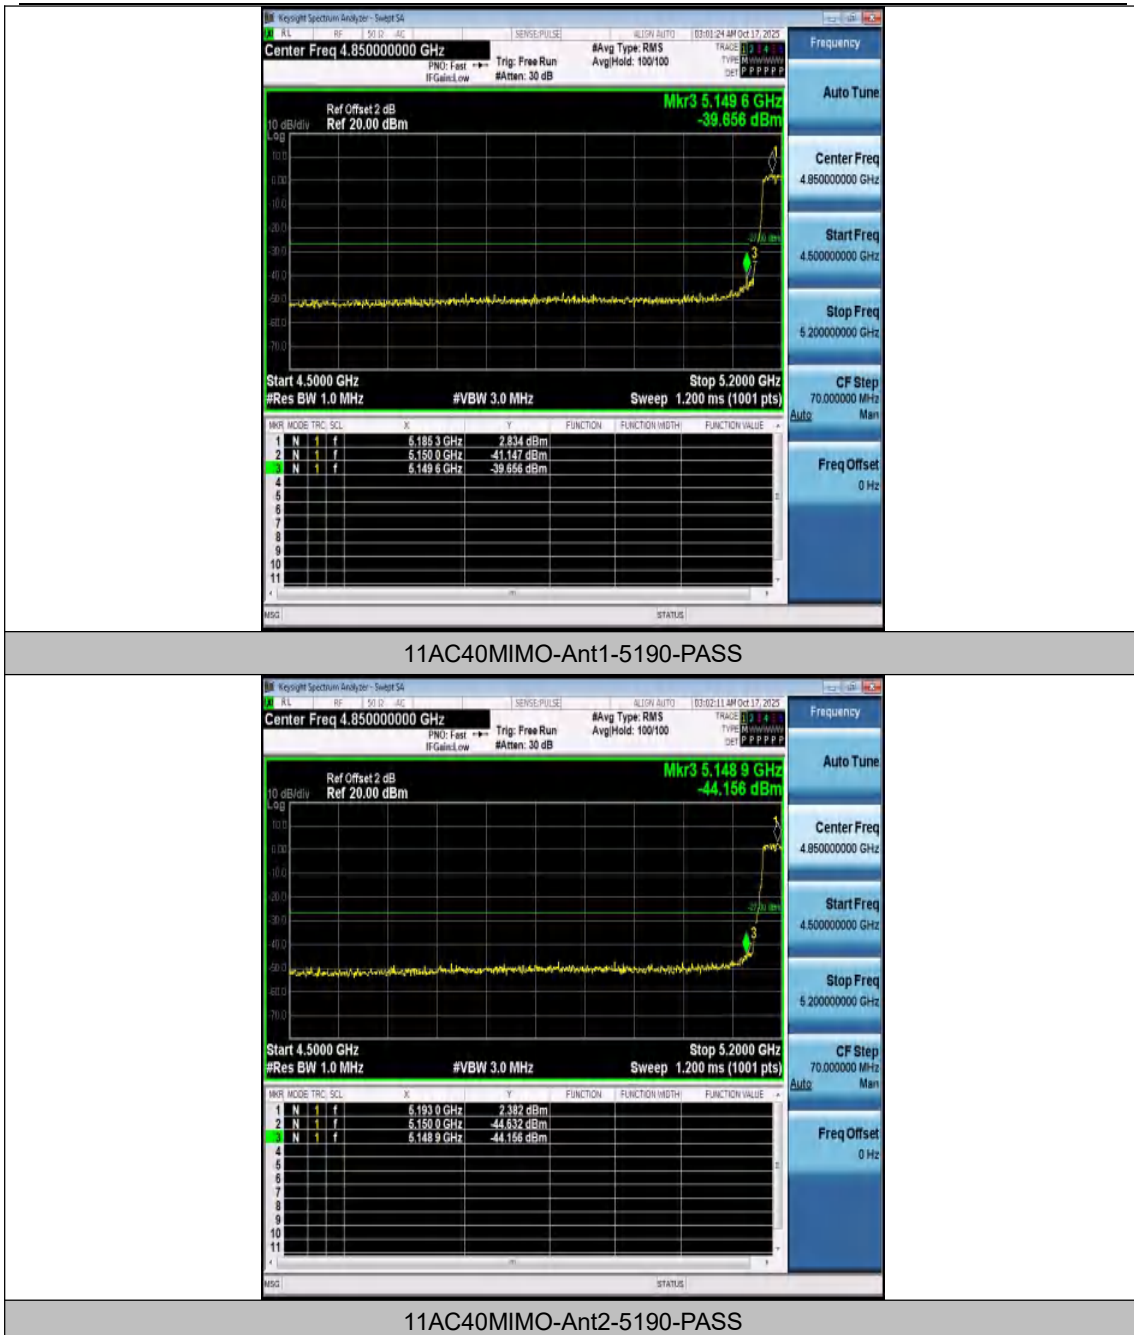




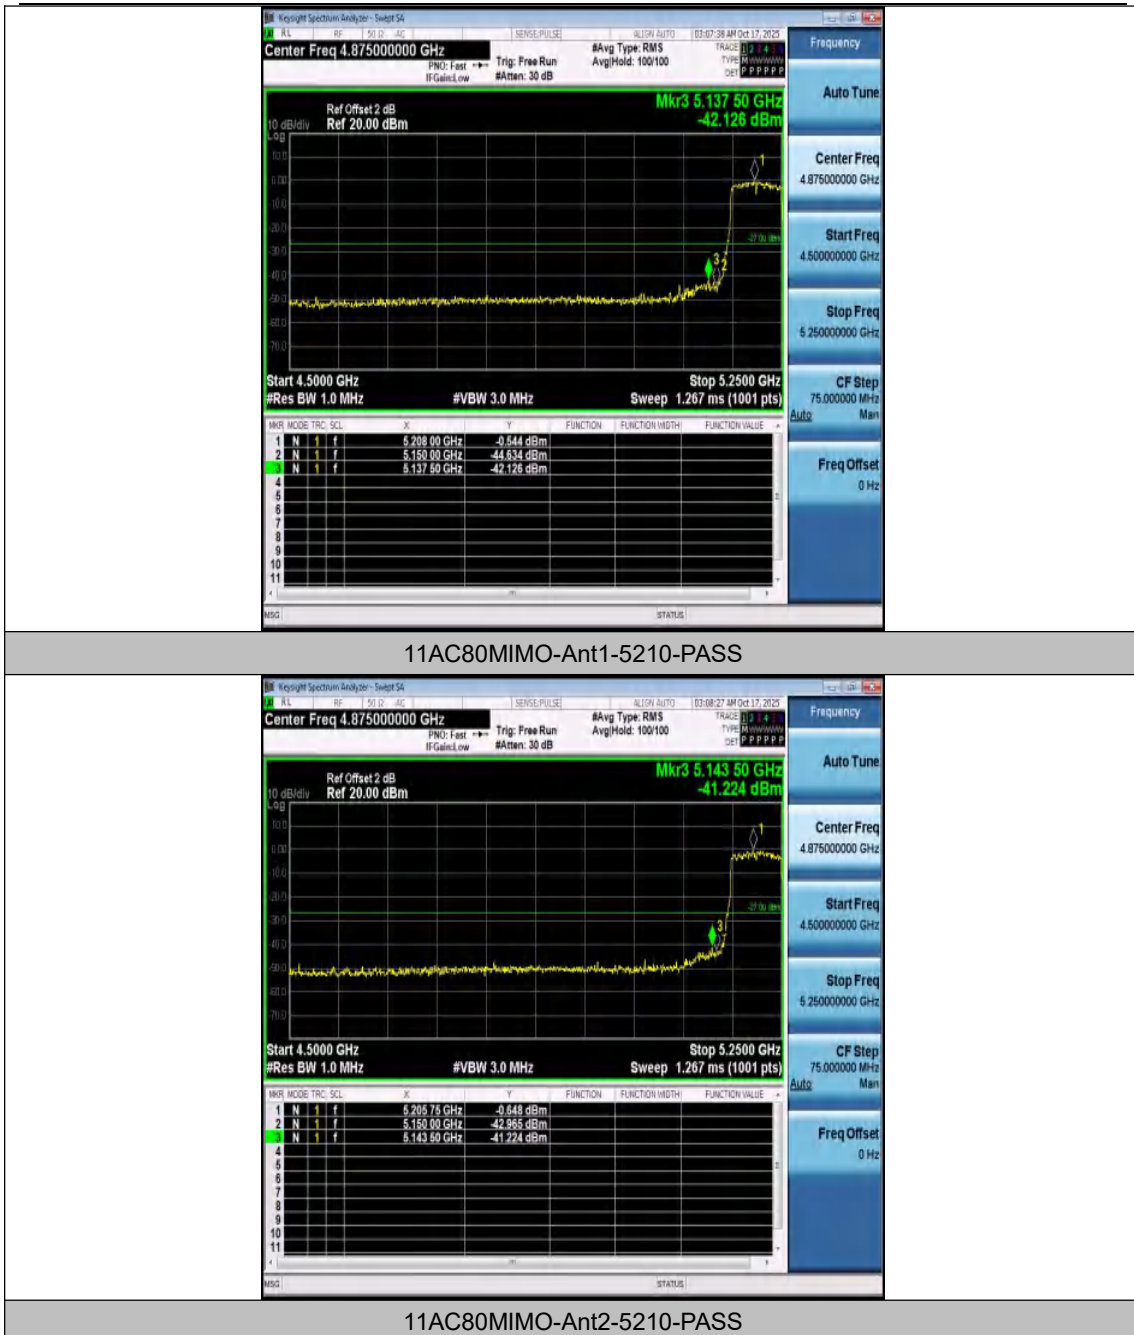




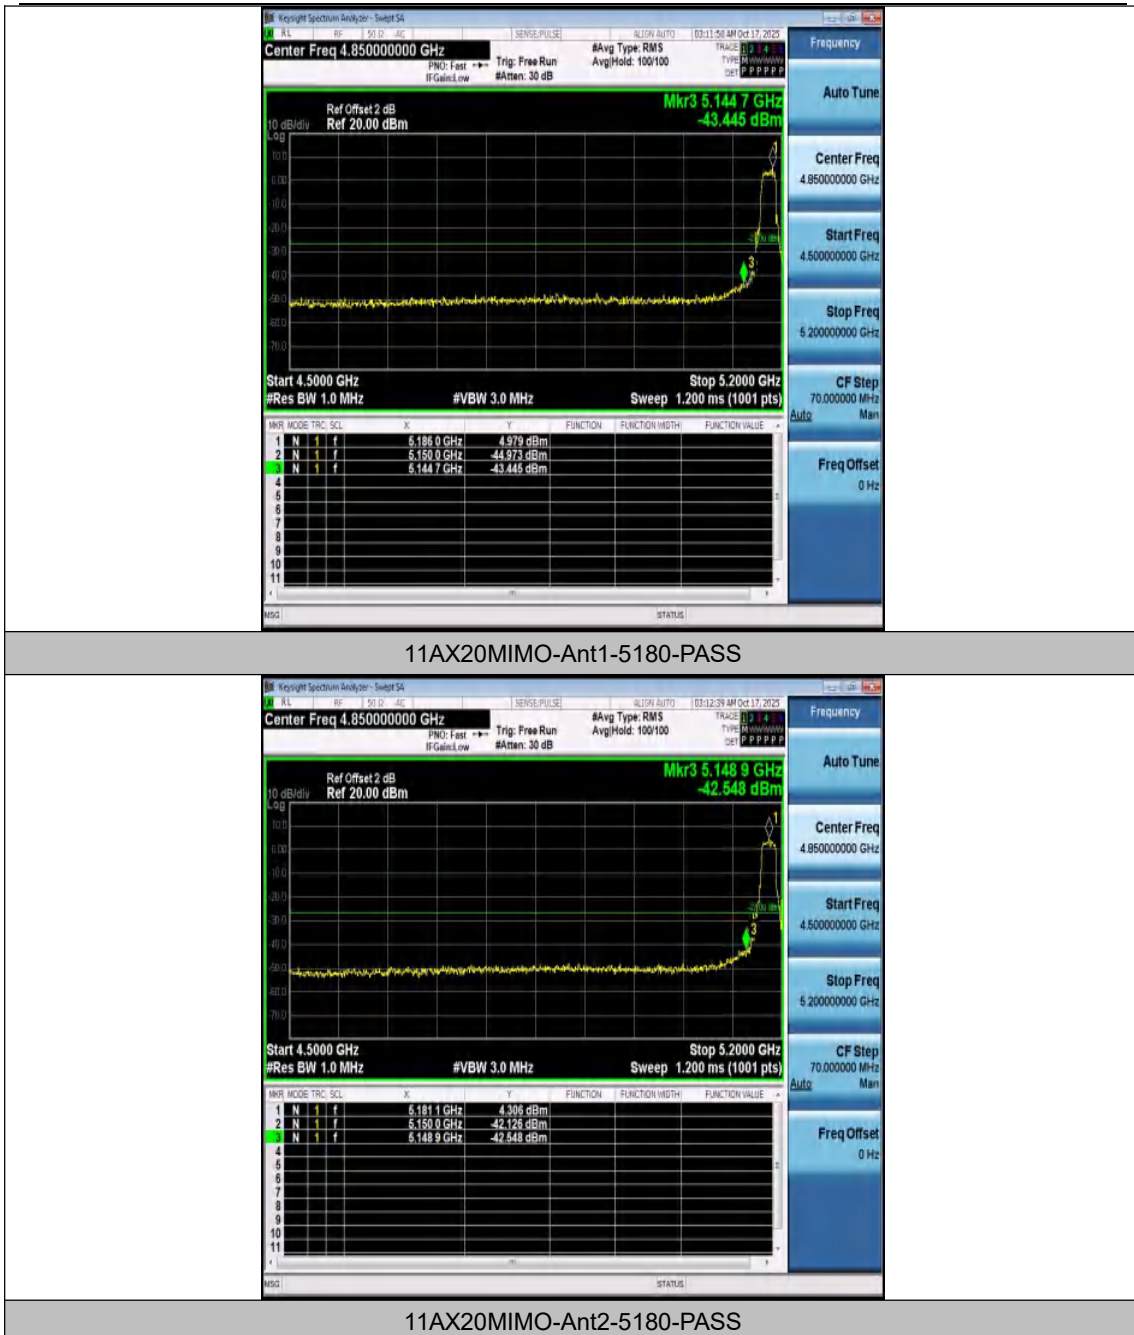



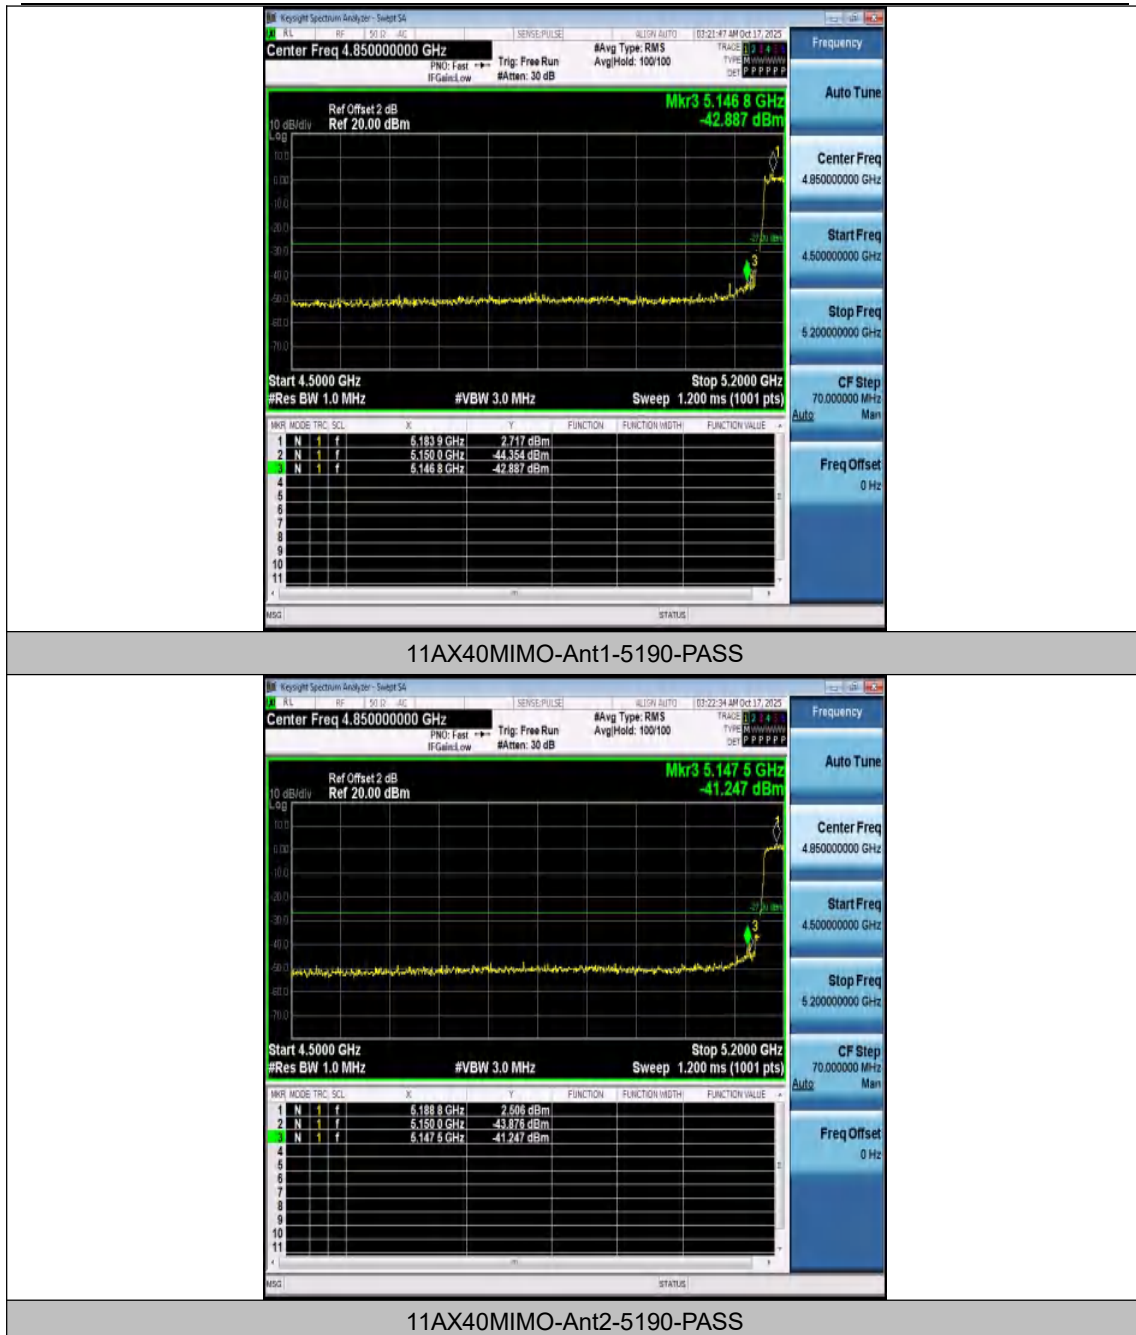



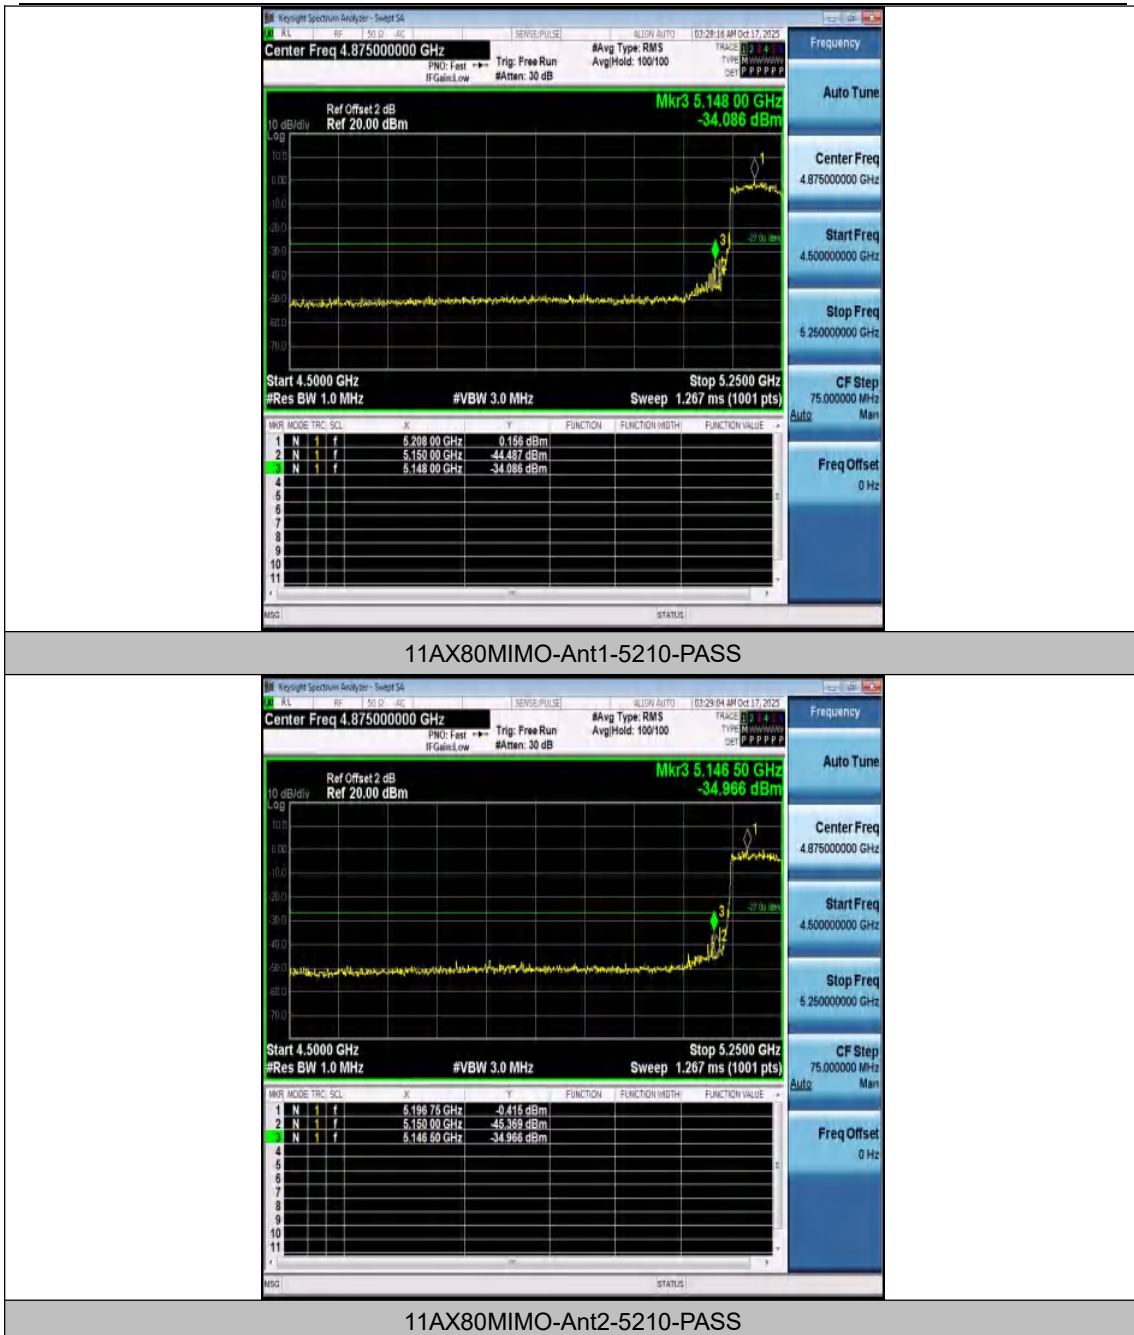



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix F: DFS Detection Thresholds

Test Result

TestMode	Frequency[dbm]	Radar Type	Result	Limit[dbm]	Verdict
11AX80SISO	5290	Type0	-63.20	-62.00	PASS

Test Graphs

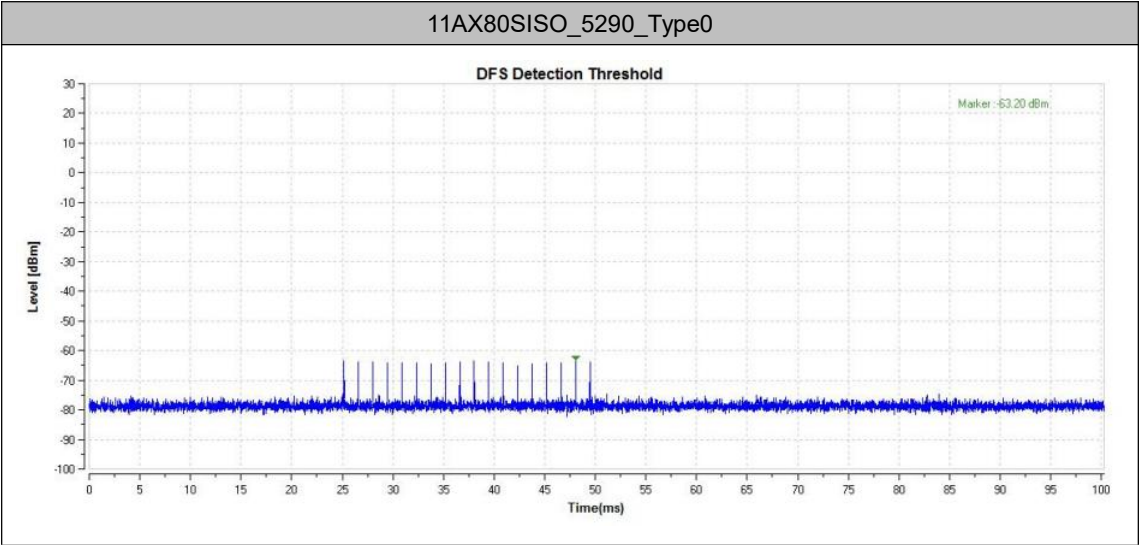


Appendix G: Channel Move Time,Channel Closing

Transmission Time,Non-Occupancy Period

Test Result

TestMode	Frequency[MHz]	CCT[ms]	Limit[ms]	CMT[ms]	Limit[ms]	Verdict
11AX80SISO	5290	200+7.8	200+60	332.7	10000	PASS


Test Graphs

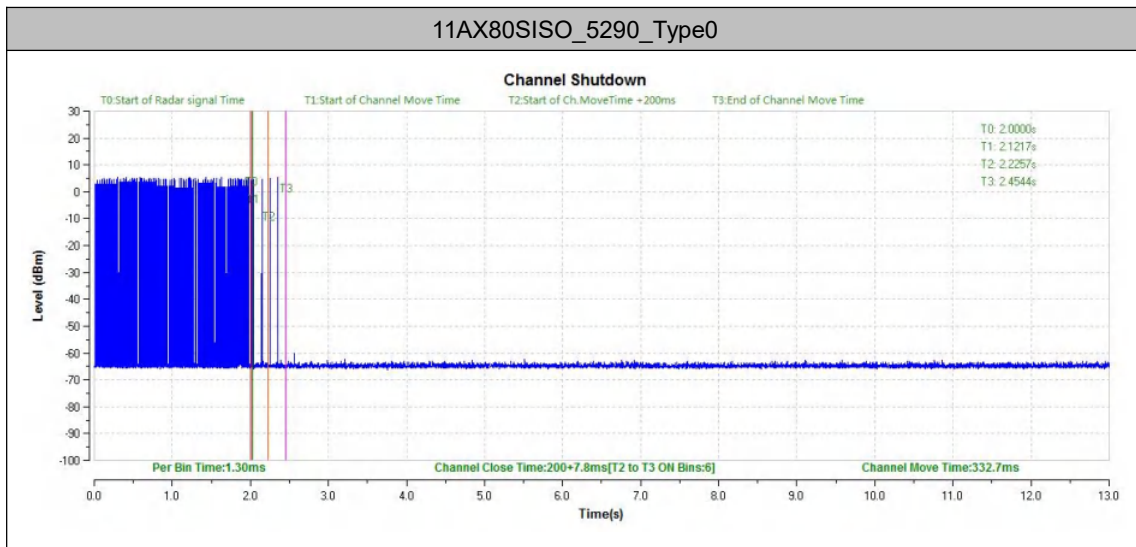

Non-Occupancy Period
Test Result

TestMode	Frequency[MHz]	Result	Limit[s]	Verdict
11AX80SISO	5290	see test graph	≥1800	PASS

Test Graphs

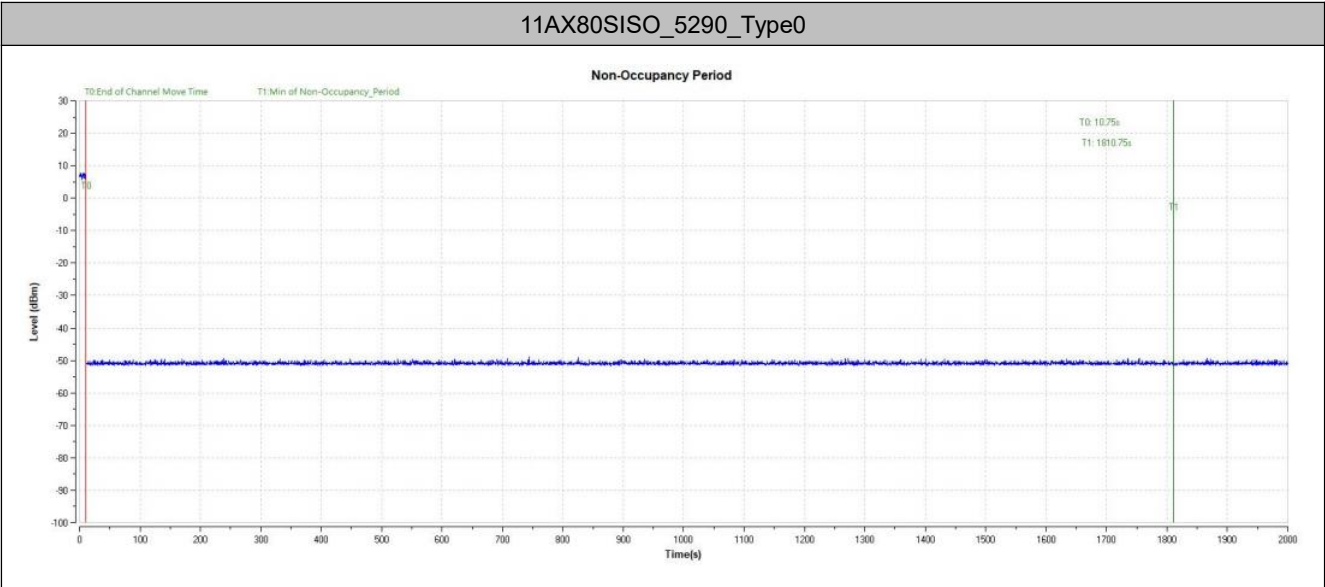

---END---