

Appendix Test Data

Report No.:	1812C50490212501-01	Test Sample No.:	1-2-2
Start Test Date:	2025-9-28	Finish Test Date:	2025-10-28
Test Engineer:	Alex Peng	Auditor:	Justin Feng
Temperature:	25.0°C	Relative Humidity:	43%
Pressure:	101kPa		



Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	26.920	5167.040	5193.960	---	---
11A	Ant2	5180	26.920	5166.680	5193.600	---	---
11A	Ant1	5220	26.440	5206.480	5232.920	---	---
11A	Ant2	5220	27.320	5206.240	5233.560	---	---
11A	Ant1	5240	26.440	5227.000	5253.440	---	---
11A	Ant2	5240	25.640	5227.360	5253.000	---	---
11A	Ant1	5260	26.520	5246.720	5273.240	---	---
11A	Ant2	5260	28.320	5245.440	5273.760	---	---
11A	Ant1	5300	27.080	5286.360	5313.440	---	---
11A	Ant2	5300	26.800	5287.040	5313.840	---	---
11A	Ant1	5320	26.240	5306.920	5333.160	---	---
11A	Ant2	5320	26.240	5306.960	5333.200	---	---
11N20MIMO	Ant1	5180	27.320	5166.400	5193.720	---	---
11N20MIMO	Ant2	5180	27.240	5166.360	5193.600	---	---
11N20MIMO	Ant1	5220	27.000	5206.440	5233.440	---	---
11N20MIMO	Ant2	5220	27.720	5206.560	5234.280	---	---
11N20MIMO	Ant1	5240	26.760	5226.960	5253.720	---	---
11N20MIMO	Ant2	5240	27.360	5226.680	5254.040	---	---
11N20MIMO	Ant1	5260	26.920	5246.520	5273.440	---	---
11N20MIMO	Ant2	5260	27.840	5246.160	5274.000	---	---
11N20MIMO	Ant1	5300	27.720	5286.320	5314.040	---	---
11N20MIMO	Ant2	5300	27.280	5286.440	5313.720	---	---
11N20MIMO	Ant1	5320	26.560	5306.440	5333.000	---	---

11N20MIMO	Ant2	5320	27.160	5306.600	5333.760	---	---
11N40MIMO	Ant1	5190	46.960	5166.880	5213.840	---	---
11N40MIMO	Ant2	5190	47.520	5166.560	5214.080	---	---
11N40MIMO	Ant1	5230	46.800	5206.560	5253.360	---	---
11N40MIMO	Ant2	5230	47.200	5206.800	5254.000	---	---
11N40MIMO	Ant1	5270	47.280	5246.960	5294.240	---	---
11N40MIMO	Ant2	5270	47.040	5246.560	5293.600	---	---
11N40MIMO	Ant1	5310	47.440	5286.400	5333.840	---	---
11N40MIMO	Ant2	5310	47.680	5286.000	5333.680	---	---
11AC20MIMO	Ant1	5180	28.080	5166.200	5194.280	---	---
11AC20MIMO	Ant2	5180	27.560	5166.520	5194.080	---	---
11AC20MIMO	Ant1	5220	27.120	5206.640	5233.760	---	---
11AC20MIMO	Ant2	5220	27.120	5206.720	5233.840	---	---
11AC20MIMO	Ant1	5240	26.640	5226.960	5253.600	---	---
11AC20MIMO	Ant2	5240	27.280	5226.800	5254.080	---	---
11AC20MIMO	Ant1	5260	27.400	5246.560	5273.960	---	---
11AC20MIMO	Ant2	5260	27.960	5246.120	5274.080	---	---
11AC20MIMO	Ant1	5300	28.280	5286.120	5314.400	---	---
11AC20MIMO	Ant2	5300	26.400	5286.840	5313.240	---	---
11AC20MIMO	Ant1	5320	27.960	5305.720	5333.680	---	---
11AC20MIMO	Ant2	5320	26.080	5307.200	5333.280	---	---
11AC40MIMO	Ant1	5190	47.600	5166.560	5214.160	---	---
11AC40MIMO	Ant2	5190	46.720	5166.720	5213.440	---	---
11AC40MIMO	Ant1	5230	47.200	5206.880	5254.080	---	---
11AC40MIMO	Ant2	5230	47.120	5206.720	5253.840	---	---
11AC40MIMO	Ant1	5270	47.200	5246.720	5293.920	---	---
11AC40MIMO	Ant2	5270	47.600	5246.800	5294.400	---	---
11AC40MIMO	Ant1	5310	48.880	5286.000	5334.880	---	---
11AC40MIMO	Ant2	5310	47.680	5286.320	5334.000	---	---
11AC80MIMO	Ant1	5210	89.280	5166.320	5255.600	---	---
11AC80MIMO	Ant2	5210	87.520	5166.320	5253.840	---	---
11AC80MIMO	Ant1	5290	88.320	5247.440	5335.760	---	---
11AC80MIMO	Ant2	5290	88.480	5246.800	5335.280	---	---
11AX20MIMO	Ant1	5180	28.120	5167.240	5195.360	---	---
11AX20MIMO	Ant2	5180	29.160	5166.960	5196.120	---	---
11AX20MIMO	Ant1	5220	29.440	5206.560	5236.000	---	---
11AX20MIMO	Ant2	5220	27.160	5207.200	5234.360	---	---
11AX20MIMO	Ant1	5240	27.360	5227.160	5254.520	---	---
11AX20MIMO	Ant2	5240	27.920	5227.360	5255.280	---	---
11AX20MIMO	Ant1	5260	27.960	5247.040	5275.000	---	---
11AX20MIMO	Ant2	5260	27.560	5247.160	5274.720	---	---
11AX20MIMO	Ant1	5300	28.760	5286.800	5315.560	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX20MIMO	Ant2	5300	28.080	5286.920	5315.000	---	---
11AX20MIMO	Ant1	5320	28.720	5307.080	5335.800	---	---
11AX20MIMO	Ant2	5320	27.680	5307.400	5335.080	---	---
11AX40MIMO	Ant1	5190	45.440	5167.840	5213.280	---	---
11AX40MIMO	Ant2	5190	44.640	5167.920	5212.560	---	---
11AX40MIMO	Ant1	5230	45.520	5207.040	5252.560	---	---
11AX40MIMO	Ant2	5230	45.520	5207.600	5253.120	---	---
11AX40MIMO	Ant1	5270	46.320	5247.760	5294.080	---	---
11AX40MIMO	Ant2	5270	44.640	5248.160	5292.800	---	---
11AX40MIMO	Ant1	5310	46.880	5287.520	5334.400	---	---
11AX40MIMO	Ant2	5310	46.640	5286.960	5333.600	---	---
11AX80MIMO	Ant1	5210	87.360	5166.320	5253.680	---	---
11AX80MIMO	Ant2	5210	87.840	5166.640	5254.480	---	---
11AX80MIMO	Ant1	5290	86.400	5247.440	5333.840	---	---
11AX80MIMO	Ant2	5290	88.960	5246.800	5335.760	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs



11A-Ant1-5180




11A-Ant2-5180

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

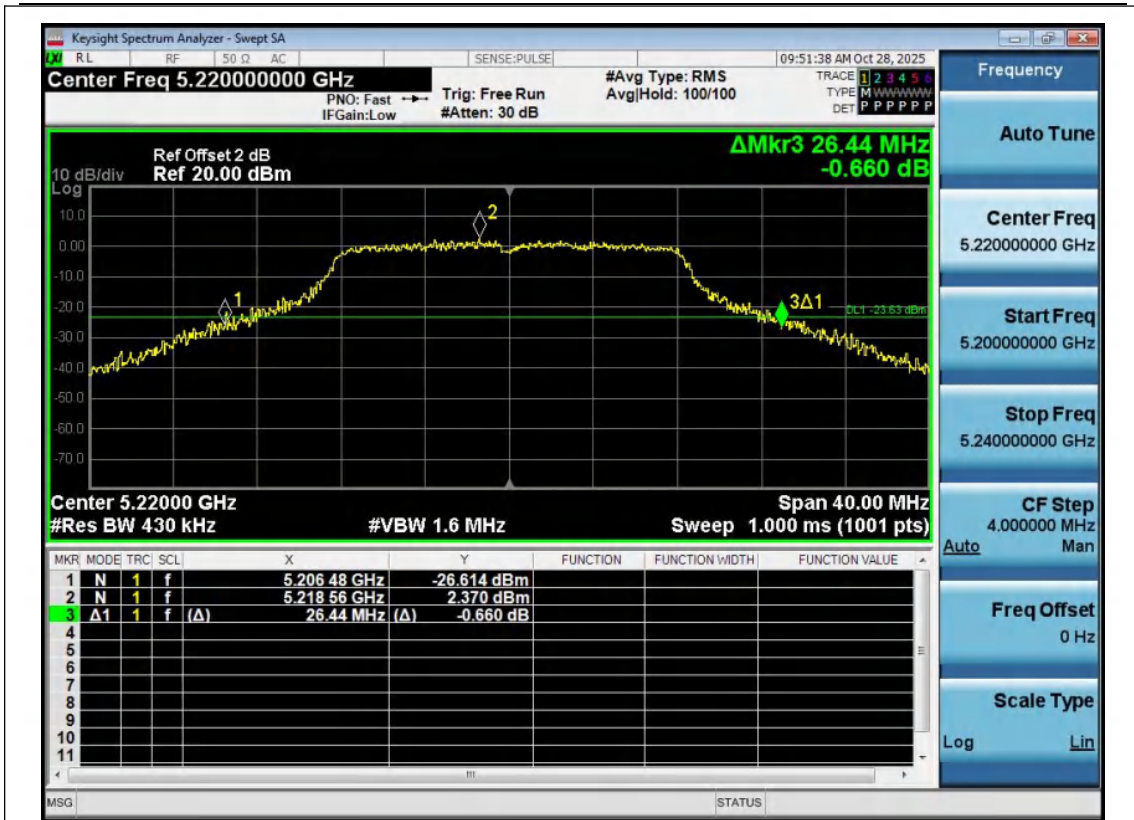

11A-Ant1-5220




11A-Ant2-5220

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

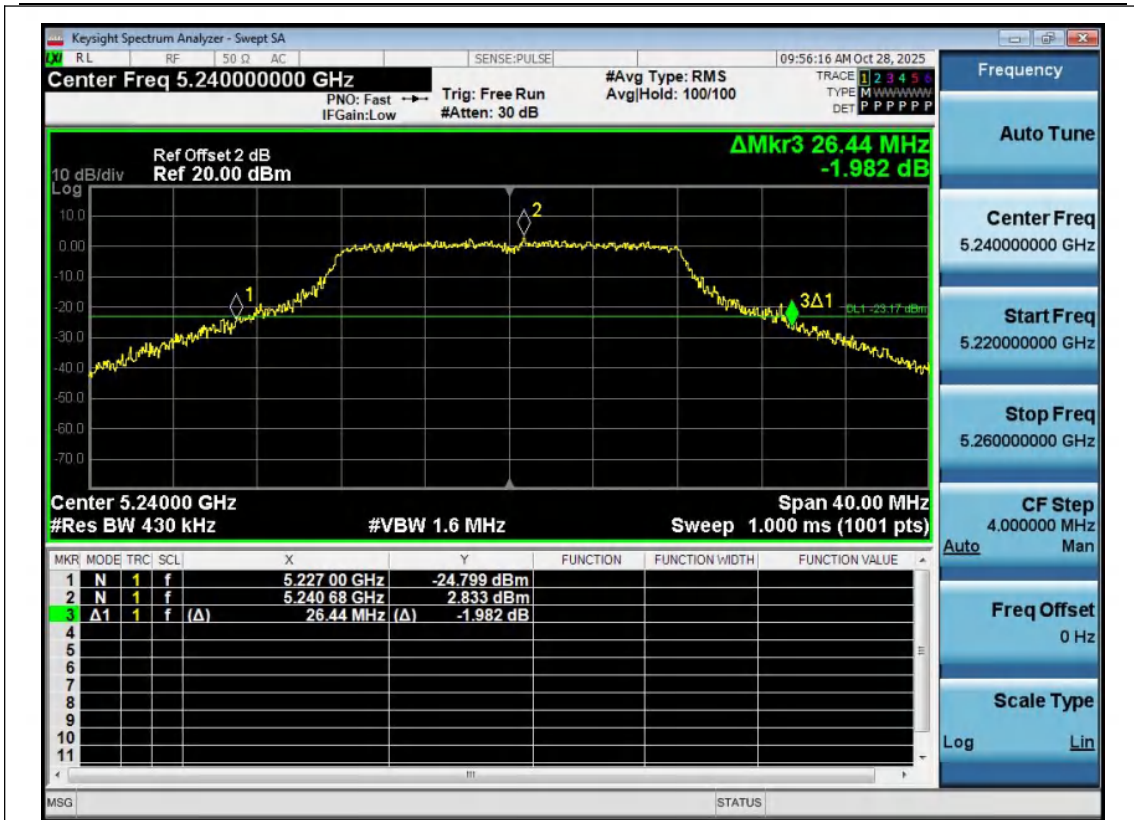

11A-Ant1-5240




11A-Ant2-5240

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

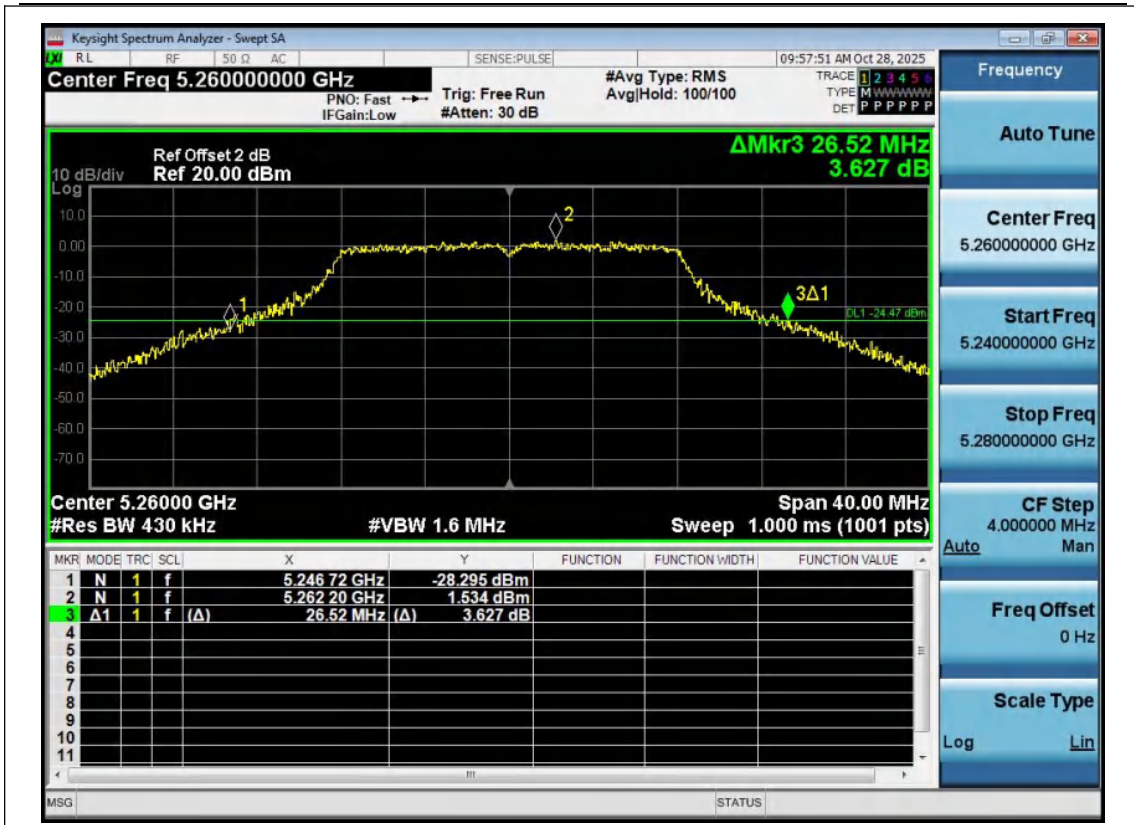

11A-Ant1-5260



11A-Ant2-5260

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11A-Ant1-5300




11A-Ant2-5300

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

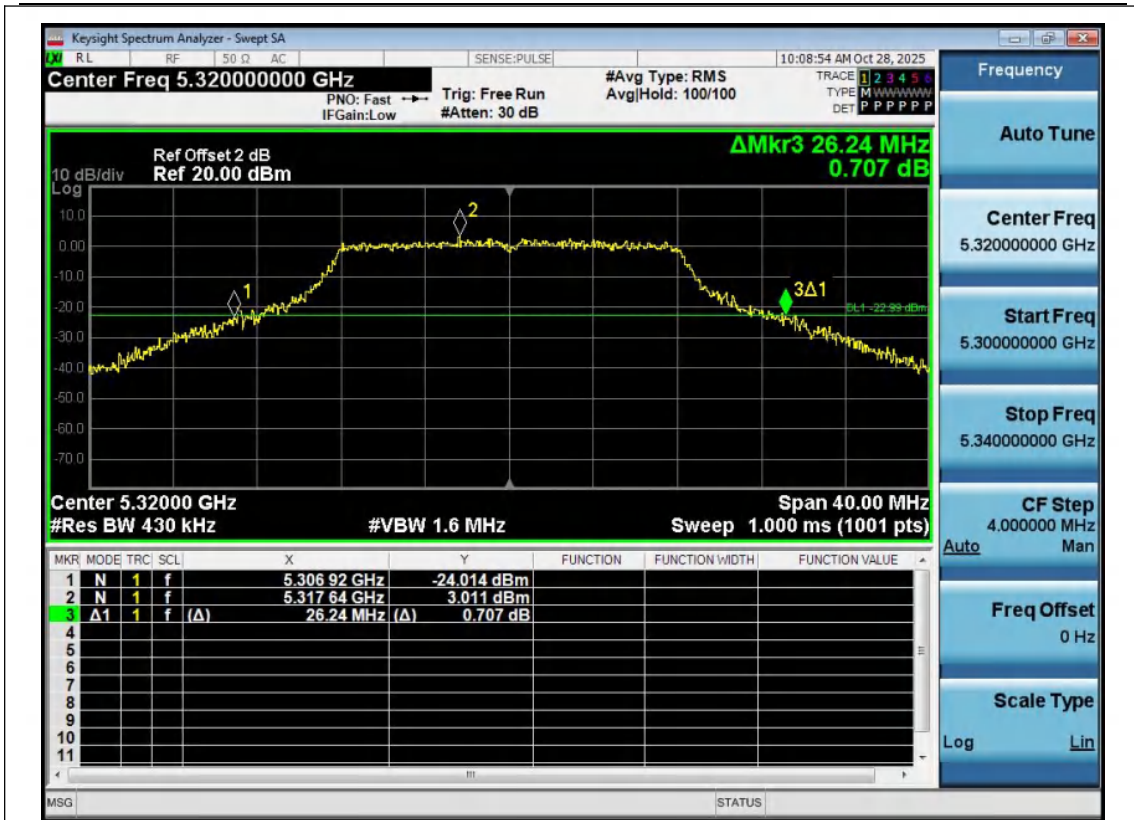

11A-Ant1-5320



11A-Ant2-5320

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11N20MIMO-Ant1-5180



11N20MIMO-Ant2-5180

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11N20MIMO-Ant1-5220



11N20MIMO-Ant2-5220

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11N20MIMO-Ant1-5240



11N20MIMO-Ant2-5240

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11N20MIMO-Ant1-5260




11N20MIMO-Ant2-5260

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

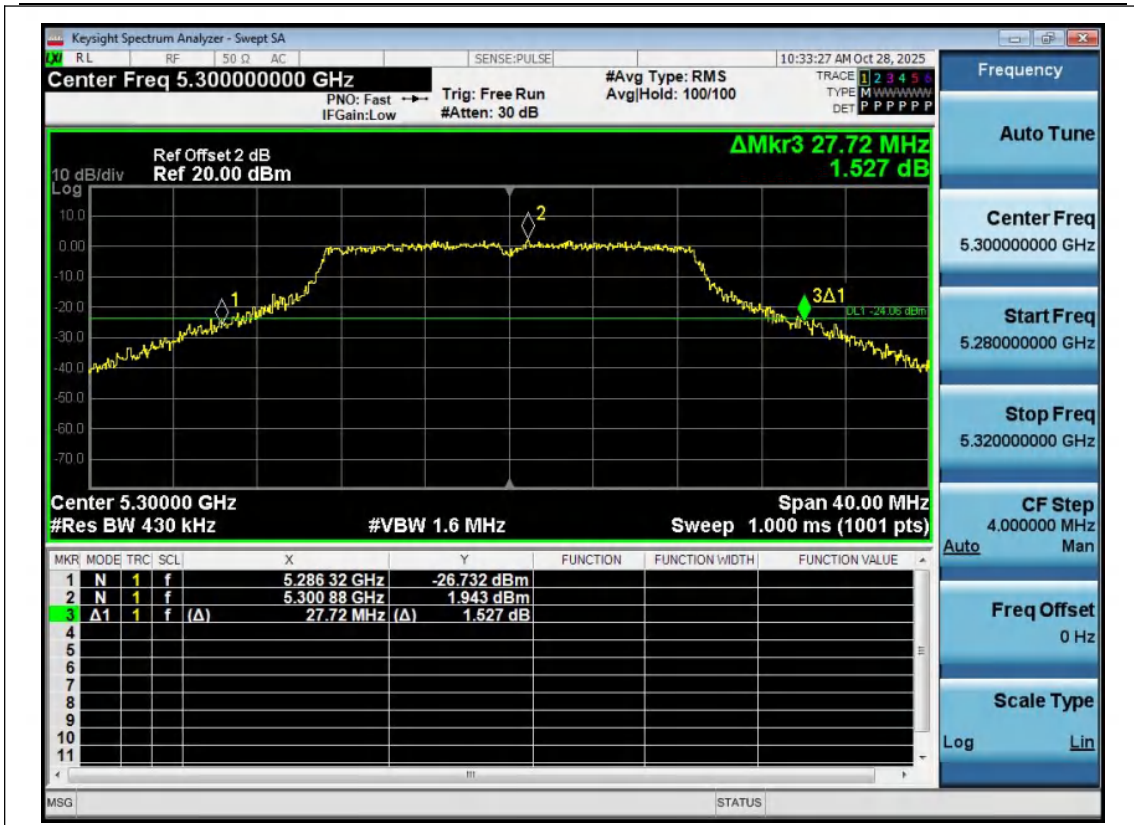

11N20MIMO-Ant1-5300



11N20MIMO-Ant2-5300

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11N20MIMO-Ant1-5320




11N20MIMO-Ant2-5320

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

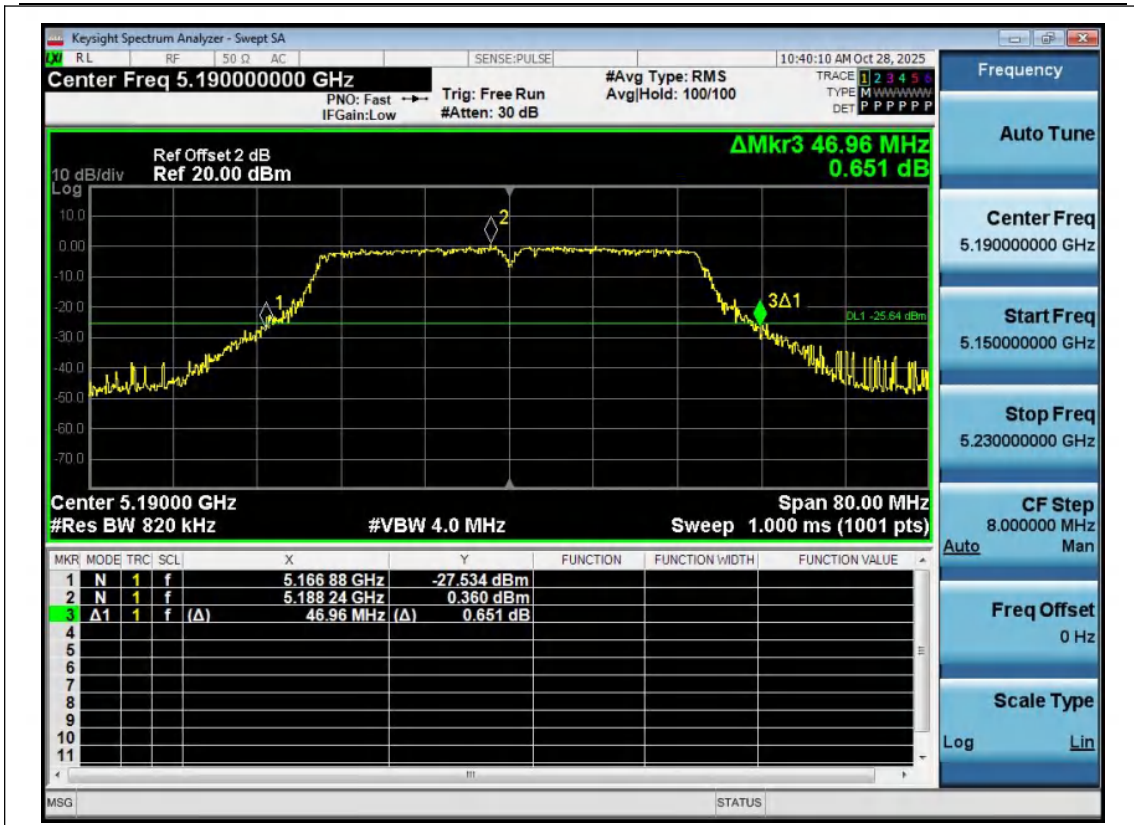

11N40MIMO-Ant1-5190



11N40MIMO-Ant2-5190

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11N40MIMO-Ant1-5230




11N40MIMO-Ant2-5230

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

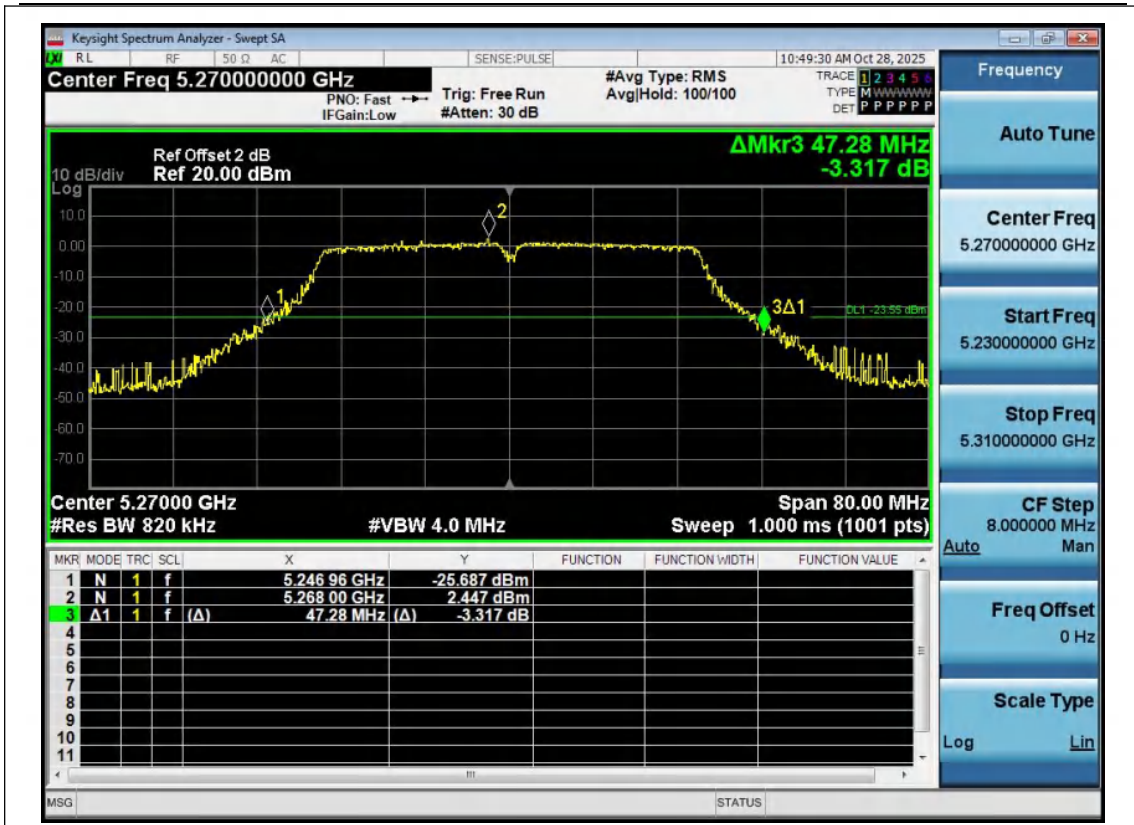

11N40MIMO-Ant1-5270




11N40MIMO-Ant2-5270

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

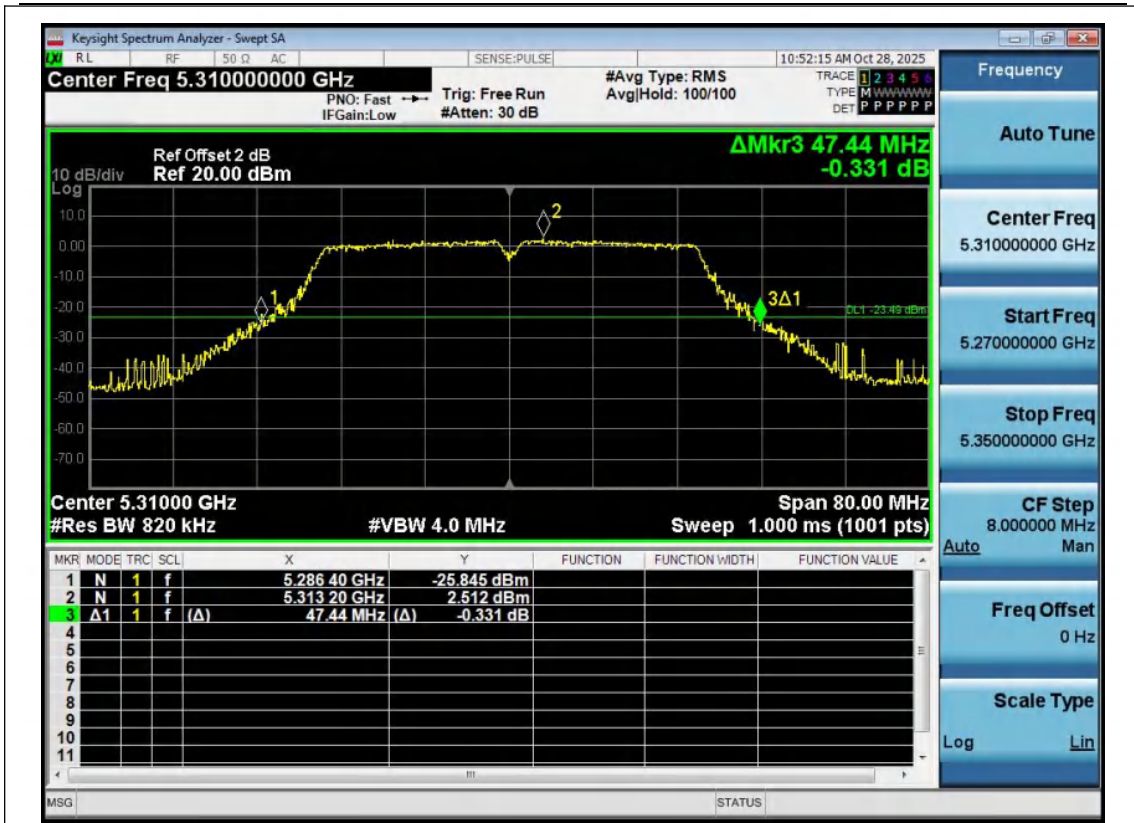

11N40MIMO-Ant1-5310



11N40MIMO-Ant2-5310

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11AC20MIMO-Ant1-5180



11AC20MIMO-Ant2-5180

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11AC20MIMO-Ant1-5220



11AC20MIMO-Ant2-5220

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11AC20MIMO-Ant1-5240




11AC20MIMO-Ant2-5240

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

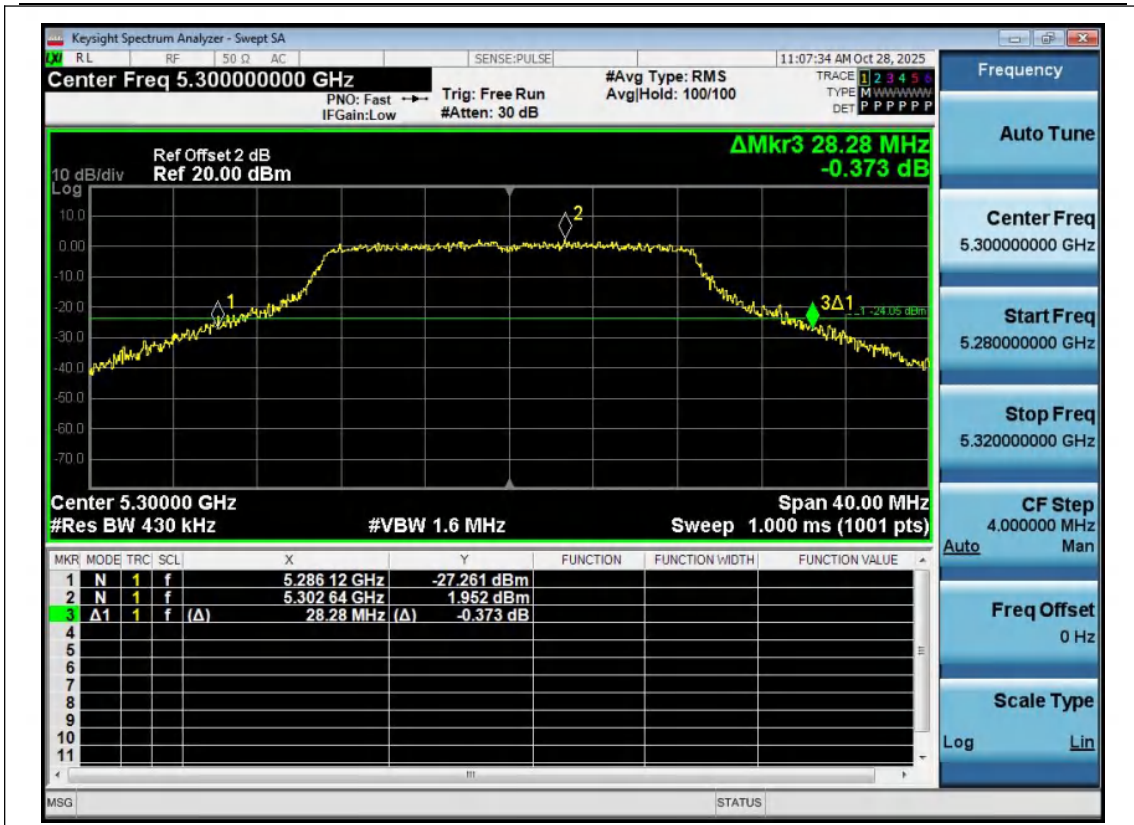

11AC20MIMO-Ant1-5300



11AC20MIMO-Ant2-5300

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11AC20MIMO-Ant1-5320



11AC20MIMO-Ant2-5320

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11AC40MIMO-Ant1-5190




11AC40MIMO-Ant2-5190

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

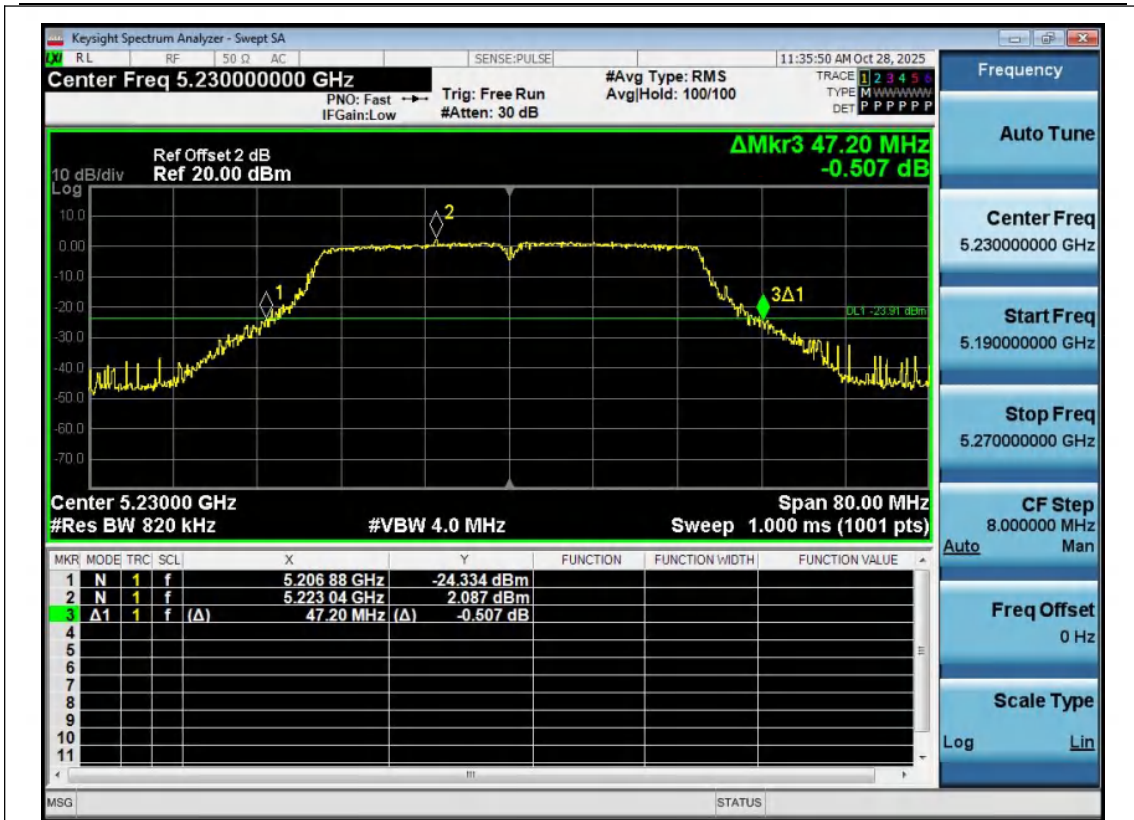

11AC40MIMO-Ant1-5230




11AC40MIMO-Ant2-5230

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

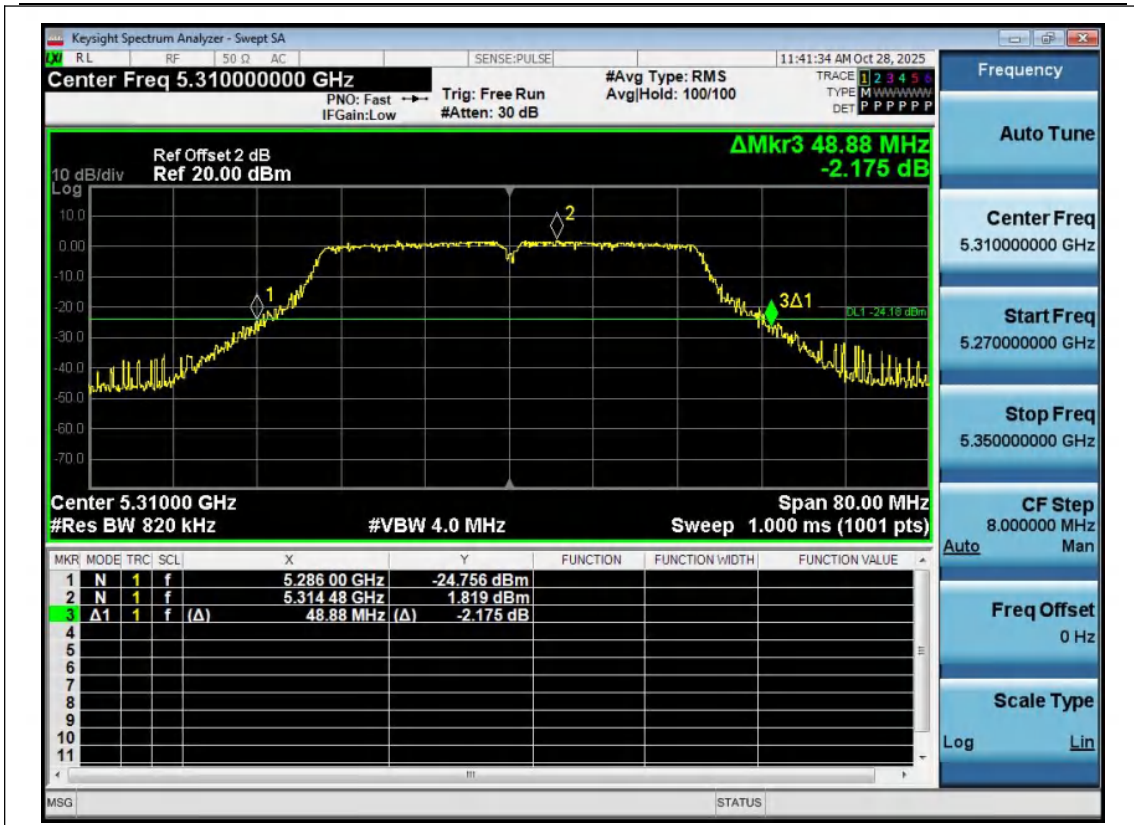

11AC40MIMO-Ant1-5310




11AC40MIMO-Ant2-5310

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

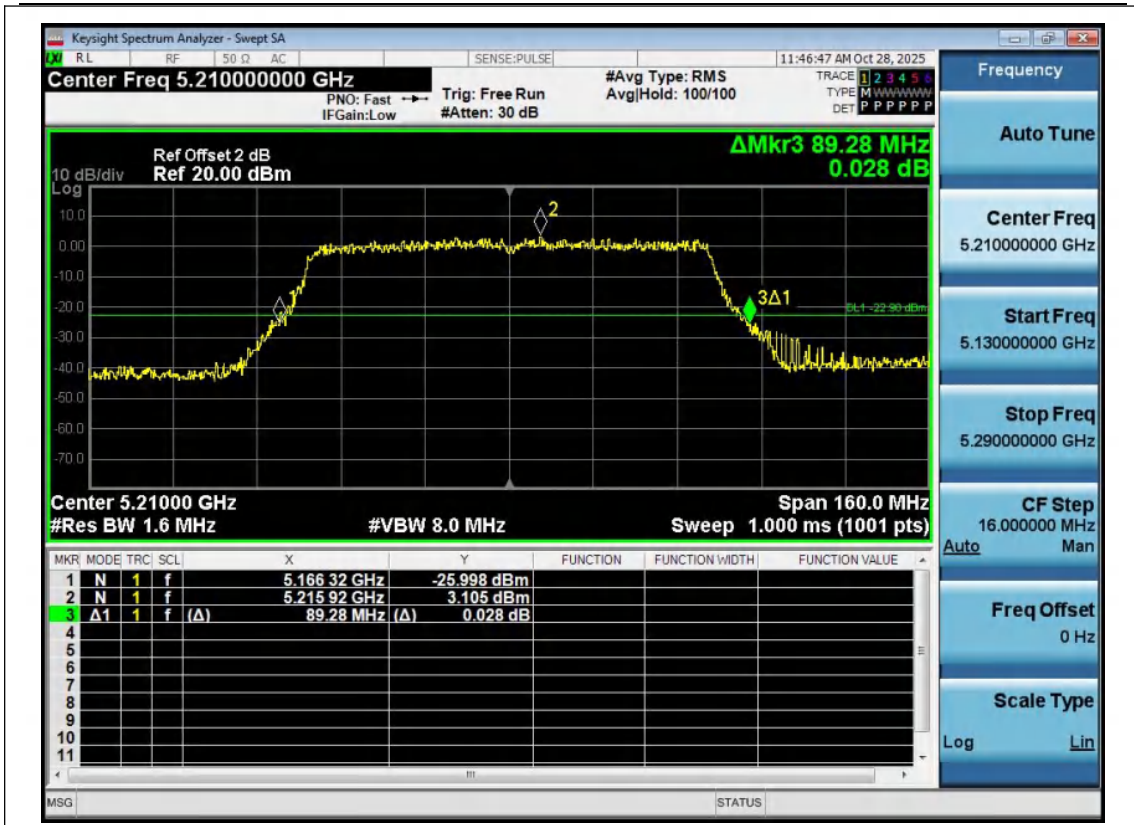

11AC80MIMO-Ant1-5210




11AC80MIMO-Ant2-5210

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

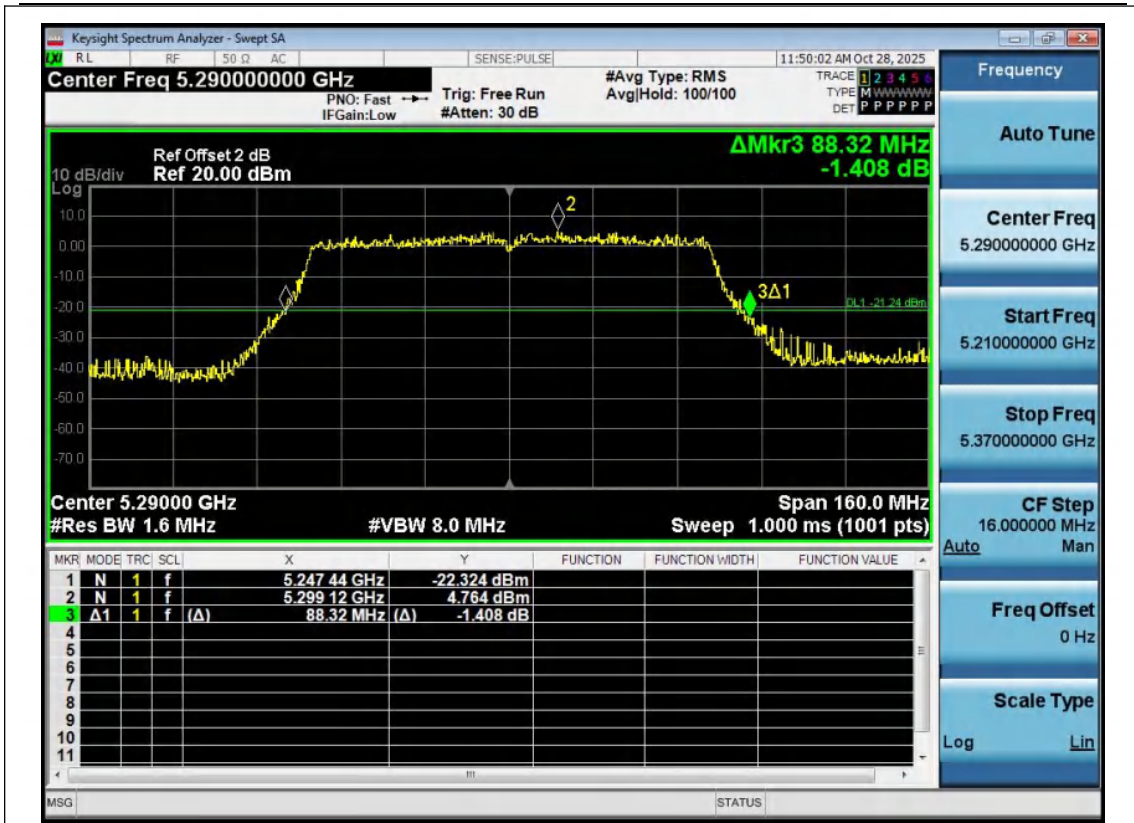

11AC80MIMO-Ant1-5290



11AC80MIMO-Ant2-5290

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11AX20MIMO-Ant1-5180




11AX20MIMO-Ant2-5180

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

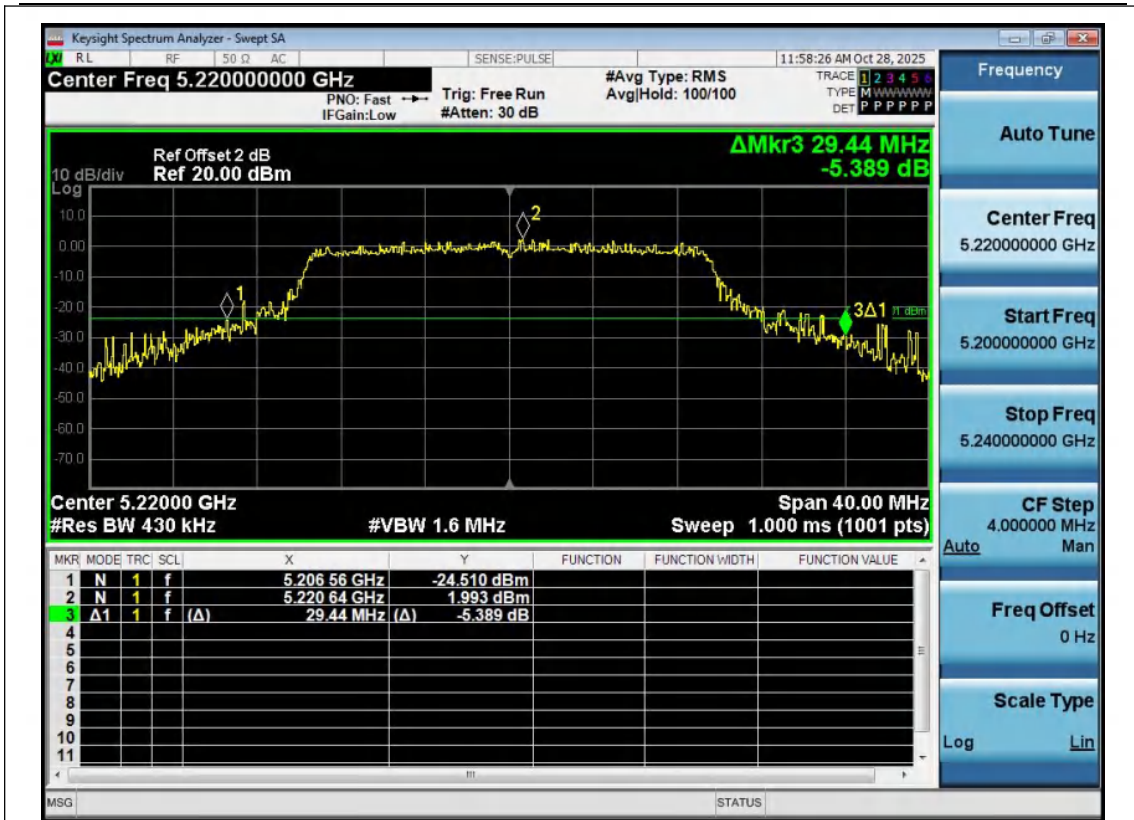

11AX20MIMO-Ant1-5220



11AX20MIMO-Ant2-5220

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11AX20MIMO-Ant1-5240



11AX20MIMO-Ant2-5240

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11AX20MIMO-Ant1-5260



11AX20MIMO-Ant2-5260

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11AX20MIMO-Ant1-5300




11AX20MIMO-Ant2-5300

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

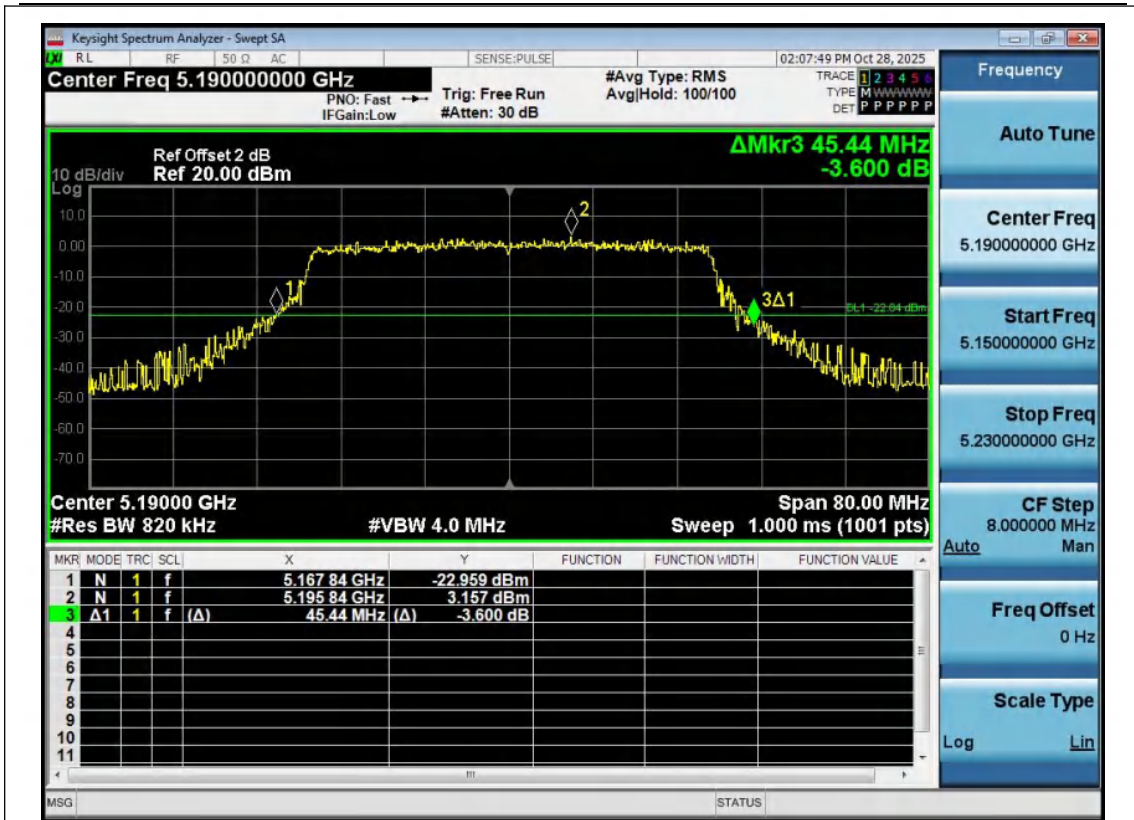

11AX40MIMO-Ant1-5190




11AX40MIMO-Ant2-5190

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

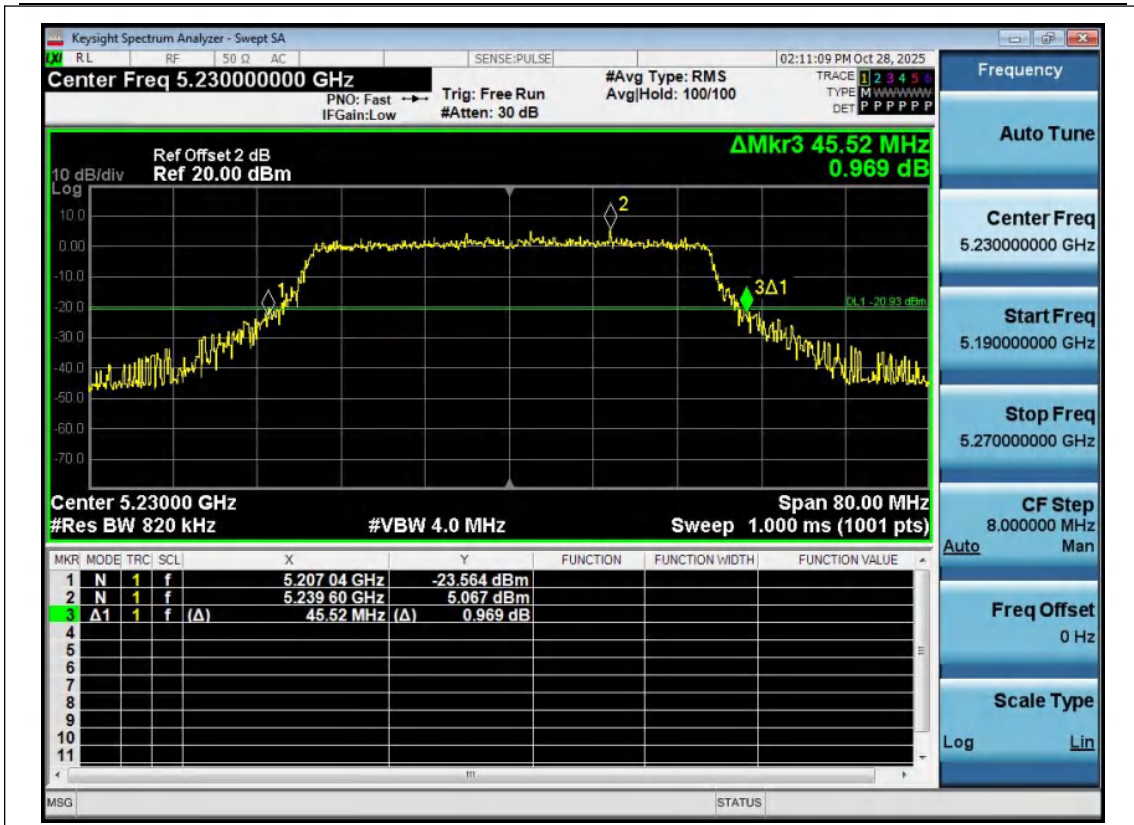

11AX40MIMO-Ant1-5230




11AX40MIMO-Ant2-5230

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

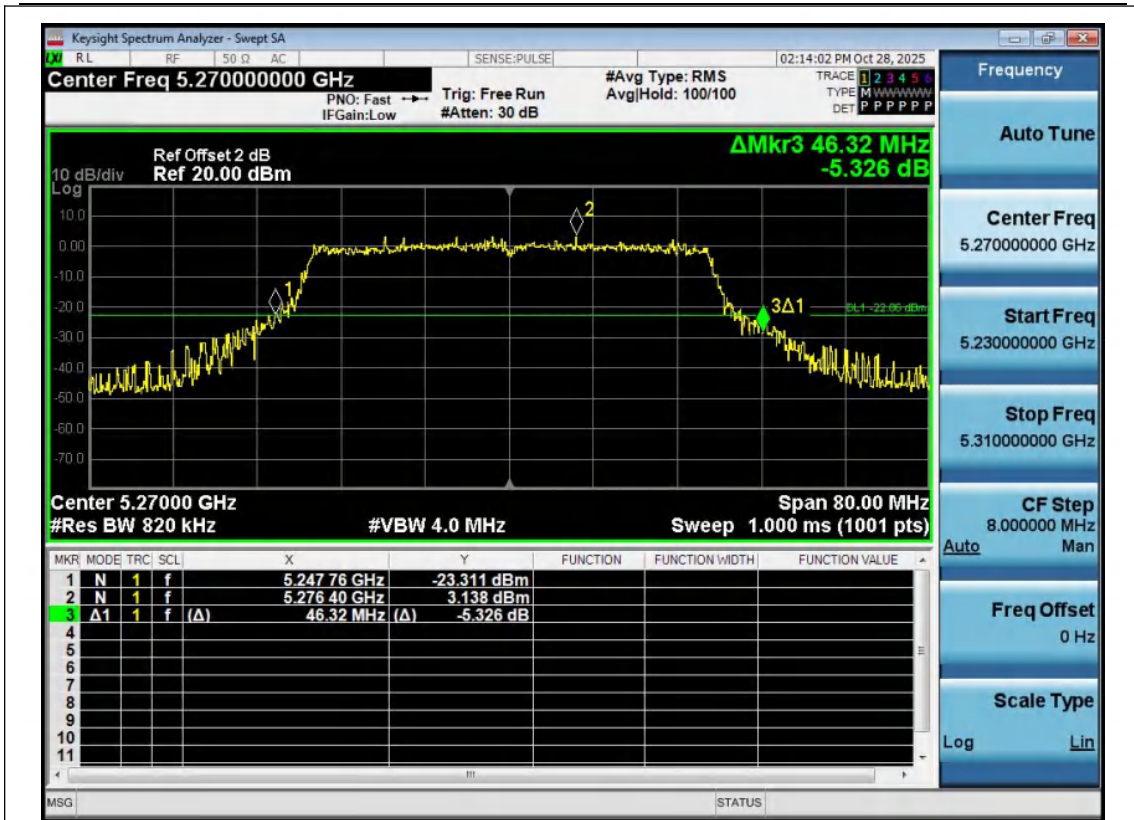

11AX40MIMO-Ant1-5270



11AX40MIMO-Ant2-5270

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11AX40MIMO-Ant1-5310




11AX40MIMO-Ant2-5310


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

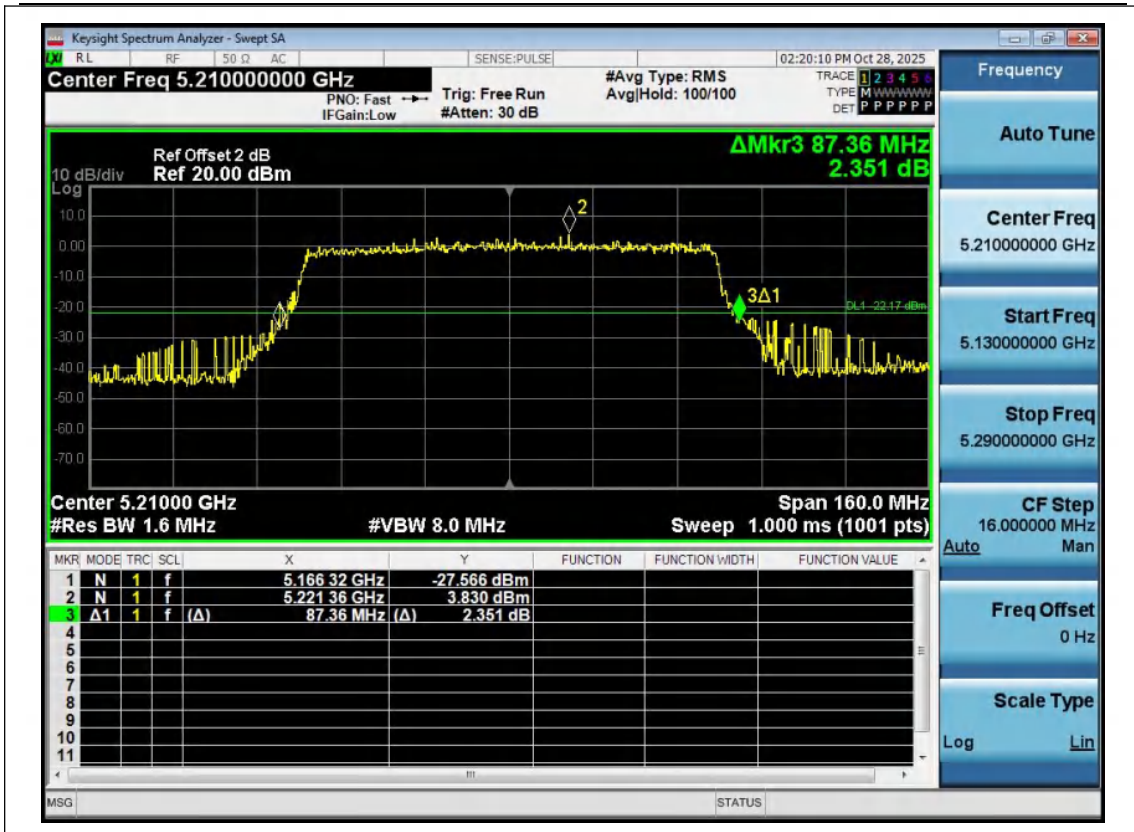

11AX80MIMO-Ant1-5210

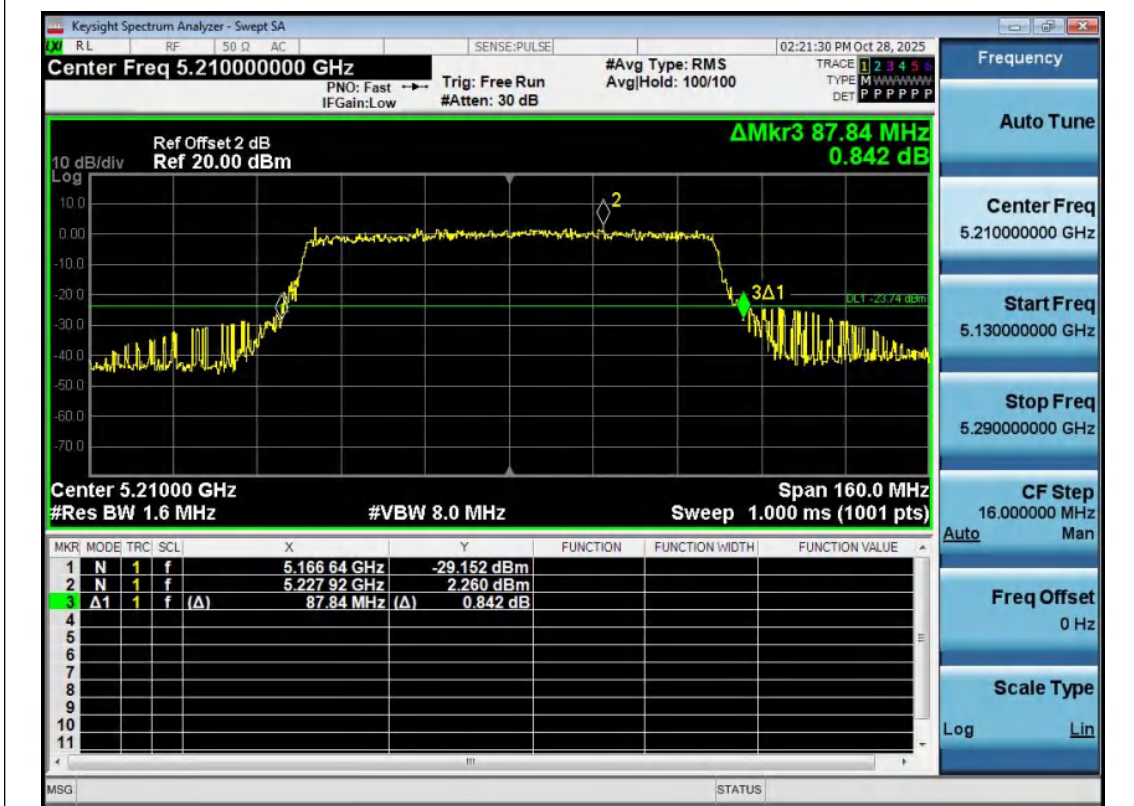


11AX80MIMO-Ant2-5210


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

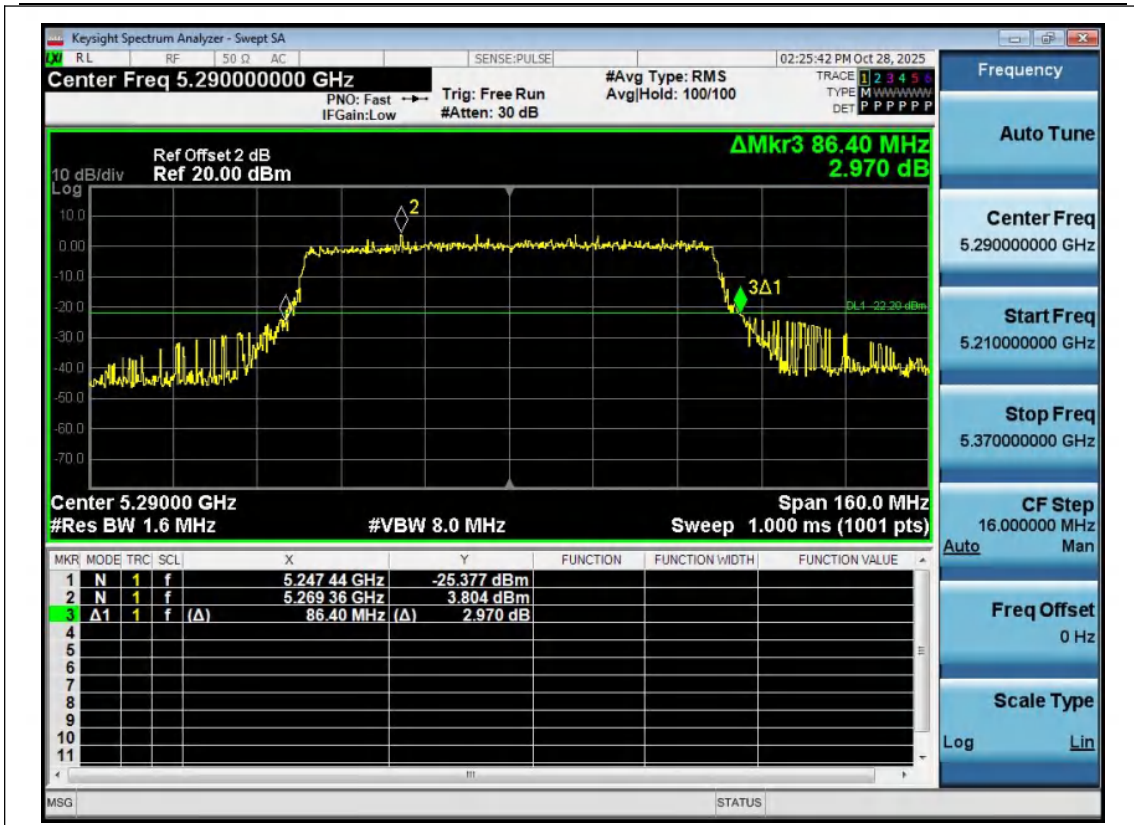

11AX80MIMO-Ant1-5290

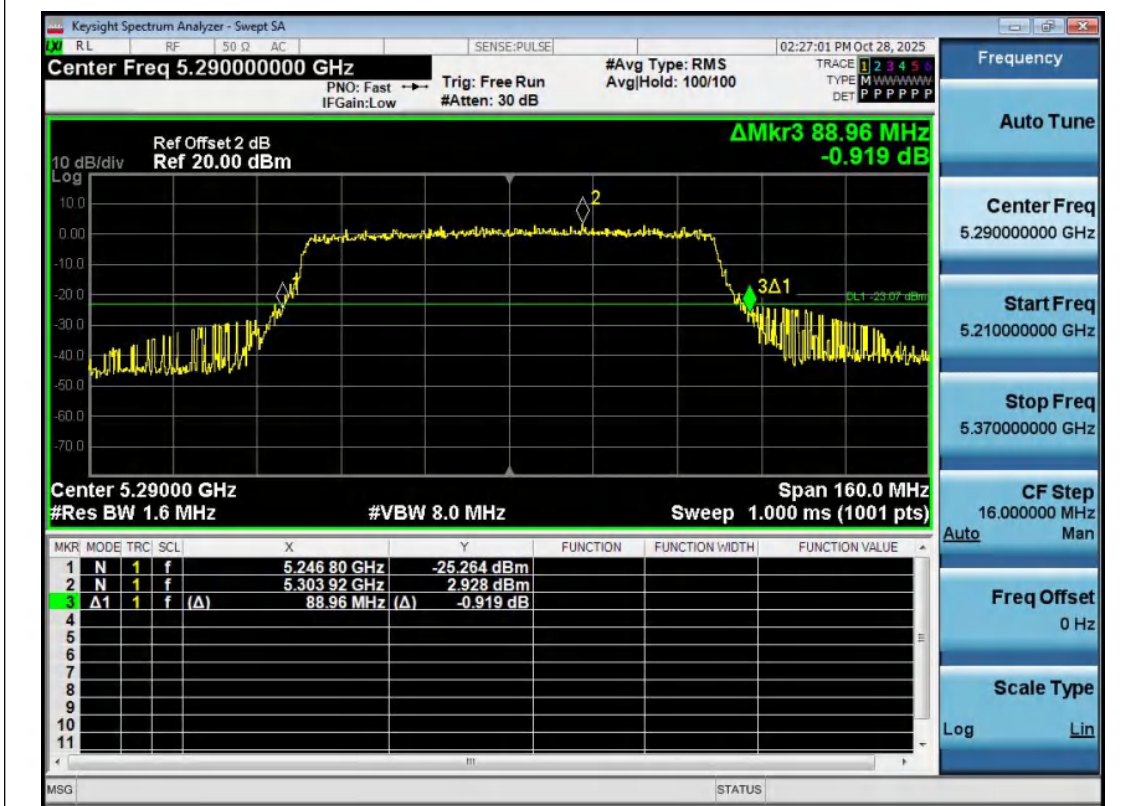

11AX80MIMO-Ant2-5290

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	17.506	5171.2184	5188.7244	---	---
11A	Ant2	5180	17.474	5171.2853	5188.7593	---	---
11A	Ant1	5220	17.502	5211.2409	5228.7429	---	---
11A	Ant2	5220	17.427	5211.3121	5228.7391	---	---
11A	Ant1	5240	17.379	5231.3428	5248.7218	---	---
11A	Ant2	5240	17.453	5231.2932	5248.7462	---	---
11A	Ant1	5260	17.569	5251.1793	5268.7483	---	---
11A	Ant2	5260	17.576	5251.2699	5268.8459	---	---
11A	Ant1	5300	17.429	5291.3350	5308.7640	---	---
11A	Ant2	5300	17.555	5291.2526	5308.8076	---	---
11A	Ant1	5320	17.485	5311.3018	5328.7868	---	---
11A	Ant2	5320	17.530	5311.2273	5328.7573	---	---
11N20MIMO	Ant1	5180	18.419	5170.8757	5189.2947	---	---
11N20MIMO	Ant2	5180	18.636	5170.6982	5189.3342	---	---
11N20MIMO	Ant1	5220	18.589	5210.7771	5229.3661	---	---
11N20MIMO	Ant2	5220	18.612	5210.7757	5229.3877	---	---
11N20MIMO	Ant1	5240	18.551	5230.7545	5249.3055	---	---
11N20MIMO	Ant2	5240	18.557	5230.7561	5249.3131	---	---
11N20MIMO	Ant1	5260	18.570	5250.8136	5269.3836	---	---
11N20MIMO	Ant2	5260	18.581	5250.7698	5269.3508	---	---
11N20MIMO	Ant1	5300	18.622	5290.7232	5309.3452	---	---
11N20MIMO	Ant2	5300	18.532	5290.7899	5309.3219	---	---
11N20MIMO	Ant1	5320	18.513	5310.8096	5329.3226	---	---
11N20MIMO	Ant2	5320	18.543	5310.7881	5329.3311	---	---
11N40MIMO	Ant1	5190	36.917	5171.7210	5208.6380	---	---
11N40MIMO	Ant2	5190	36.952	5171.6954	5208.6474	---	---
11N40MIMO	Ant1	5230	36.768	5211.7961	5248.5641	---	---
11N40MIMO	Ant2	5230	36.846	5211.7225	5248.5685	---	---
11N40MIMO	Ant1	5270	36.812	5251.7625	5288.5745	---	---
11N40MIMO	Ant2	5270	36.866	5251.7295	5288.5955	---	---
11N40MIMO	Ant1	5310	36.918	5291.7053	5328.6233	---	---
11N40MIMO	Ant2	5310	36.854	5291.7310	5328.5850	---	---
11AC20MIMO	Ant1	5180	18.611	5170.7866	5189.3976	---	---
11AC20MIMO	Ant2	5180	18.566	5170.7358	5189.3018	---	---
11AC20MIMO	Ant1	5220	18.540	5210.7851	5229.3251	---	---
11AC20MIMO	Ant2	5220	18.639	5210.7360	5229.3750	---	---
11AC20MIMO	Ant1	5240	18.589	5230.8060	5249.3950	---	---

11AC20MIMO	Ant2	5240	18.545	5230.8051	5249.3501	---	---
11AC20MIMO	Ant1	5260	18.530	5250.7994	5269.3294	---	---
11AC20MIMO	Ant2	5260	18.486	5250.8115	5269.2975	---	---
11AC20MIMO	Ant1	5300	18.481	5290.8091	5309.2901	---	---
11AC20MIMO	Ant2	5300	18.553	5290.7944	5309.3474	---	---
11AC20MIMO	Ant1	5320	18.541	5310.7595	5329.3005	---	---
11AC20MIMO	Ant2	5320	18.486	5310.8426	5329.3286	---	---
11AC40MIMO	Ant1	5190	36.972	5171.6970	5208.6690	---	---
11AC40MIMO	Ant2	5190	36.863	5171.7051	5208.5681	---	---
11AC40MIMO	Ant1	5230	36.802	5211.7200	5248.5220	---	---
11AC40MIMO	Ant2	5230	36.911	5211.7262	5248.6372	---	---
11AC40MIMO	Ant1	5270	36.888	5251.6849	5288.5729	---	---
11AC40MIMO	Ant2	5270	36.916	5251.6711	5288.5871	---	---
11AC40MIMO	Ant1	5310	36.909	5291.7076	5328.6166	---	---
11AC40MIMO	Ant2	5310	37.066	5291.5851	5328.6511	---	---
11AC80MIMO	Ant1	5210	76.308	5172.1761	5248.4841	---	---
11AC80MIMO	Ant2	5210	76.277	5172.1861	5248.4631	---	---
11AC80MIMO	Ant1	5290	76.092	5252.2971	5328.3891	---	---
11AC80MIMO	Ant2	5290	76.144	5252.3298	5328.4738	---	---
11AX20MIMO	Ant1	5180	19.222	5170.4329	5189.6549	---	---
11AX20MIMO	Ant2	5180	19.319	5170.3979	5189.7169	---	---
11AX20MIMO	Ant1	5220	19.317	5210.3848	5229.7018	---	---
11AX20MIMO	Ant2	5220	19.323	5210.4021	5229.7251	---	---
11AX20MIMO	Ant1	5240	19.367	5230.3640	5249.7310	---	---
11AX20MIMO	Ant2	5240	19.289	5230.4343	5249.7233	---	---
11AX20MIMO	Ant1	5260	19.300	5250.3901	5269.6901	---	---
11AX20MIMO	Ant2	5260	19.396	5250.3353	5269.7313	---	---
11AX20MIMO	Ant1	5300	19.272	5290.3985	5309.6705	---	---
11AX20MIMO	Ant2	5300	19.334	5290.4189	5309.7529	---	---
11AX20MIMO	Ant1	5320	19.359	5310.4524	5329.8114	---	---
11AX20MIMO	Ant2	5320	19.390	5310.4027	5329.7927	---	---
11AX40MIMO	Ant1	5190	38.172	5171.0553	5209.2273	---	---
11AX40MIMO	Ant2	5190	38.040	5171.0852	5209.1252	---	---
11AX40MIMO	Ant1	5230	38.161	5211.0251	5249.1861	---	---
11AX40MIMO	Ant2	5230	38.291	5211.0136	5249.3046	---	---
11AX40MIMO	Ant1	5270	38.110	5251.0793	5289.1893	---	---
11AX40MIMO	Ant2	5270	38.155	5251.0349	5289.1899	---	---
11AX40MIMO	Ant1	5310	38.228	5290.9986	5329.2266	---	---
11AX40MIMO	Ant2	5310	38.144	5290.9826	5329.1266	---	---
11AX80MIMO	Ant1	5210	77.674	5171.5024	5249.1764	---	---
11AX80MIMO	Ant2	5210	77.728	5171.4670	5249.1950	---	---
11AX80MIMO	Ant1	5290	77.598	5251.5058	5329.1038	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX80MIMO	Ant2	5290	77.485	5251.5934	5329.0784	---	---
------------	------	------	--------	-----------	-----------	-----	-----

Test Graphs



11A-Ant1-5180

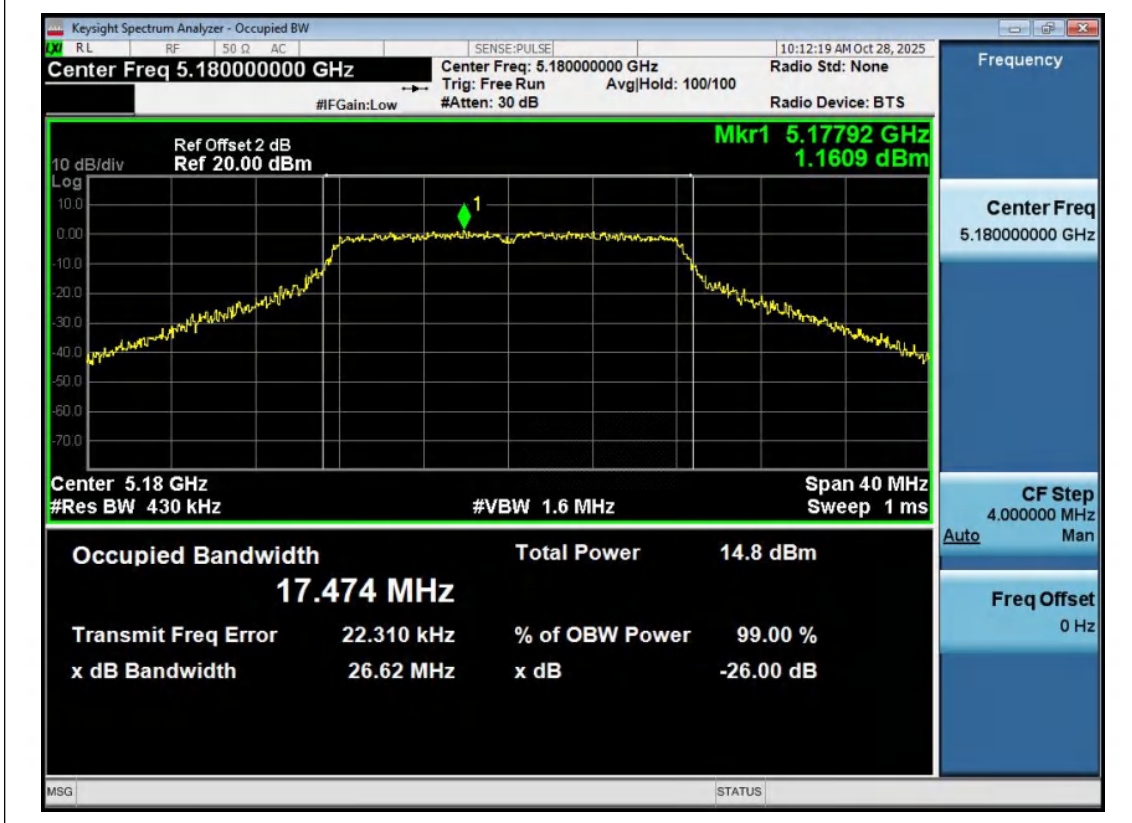


11A-Ant2-5180


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

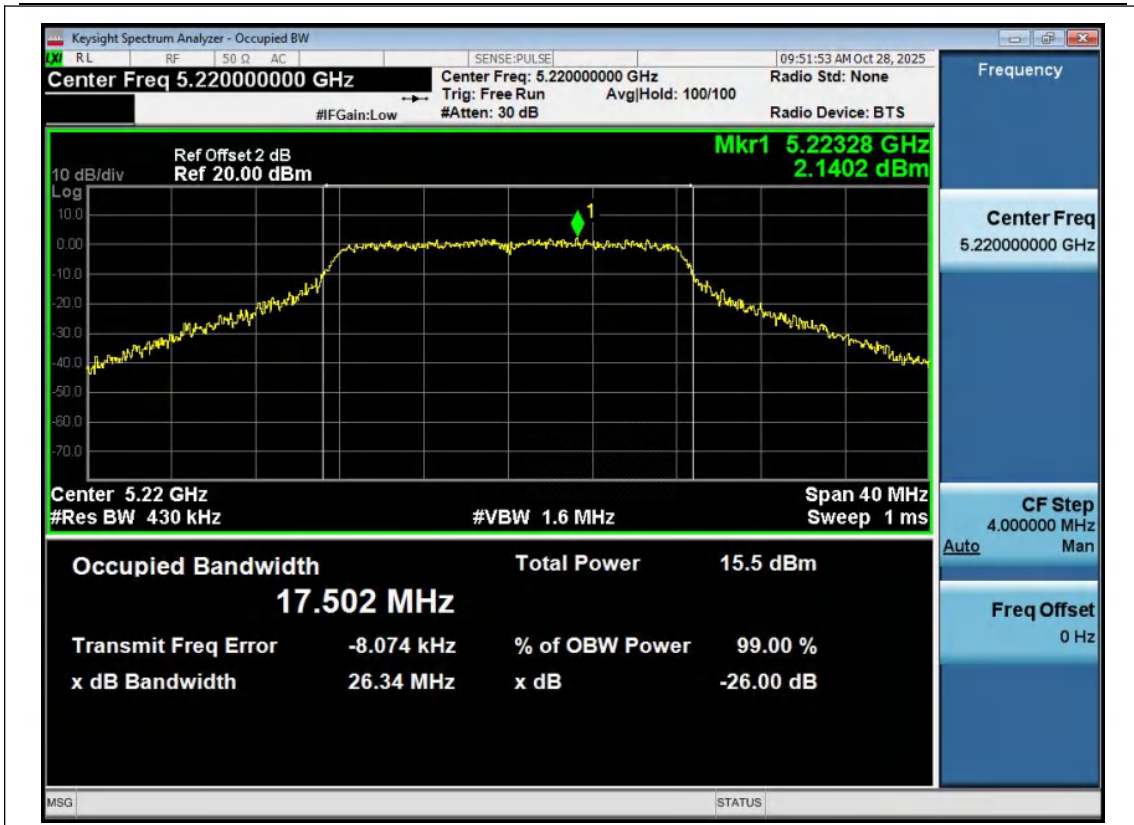

11A-Ant1-5220

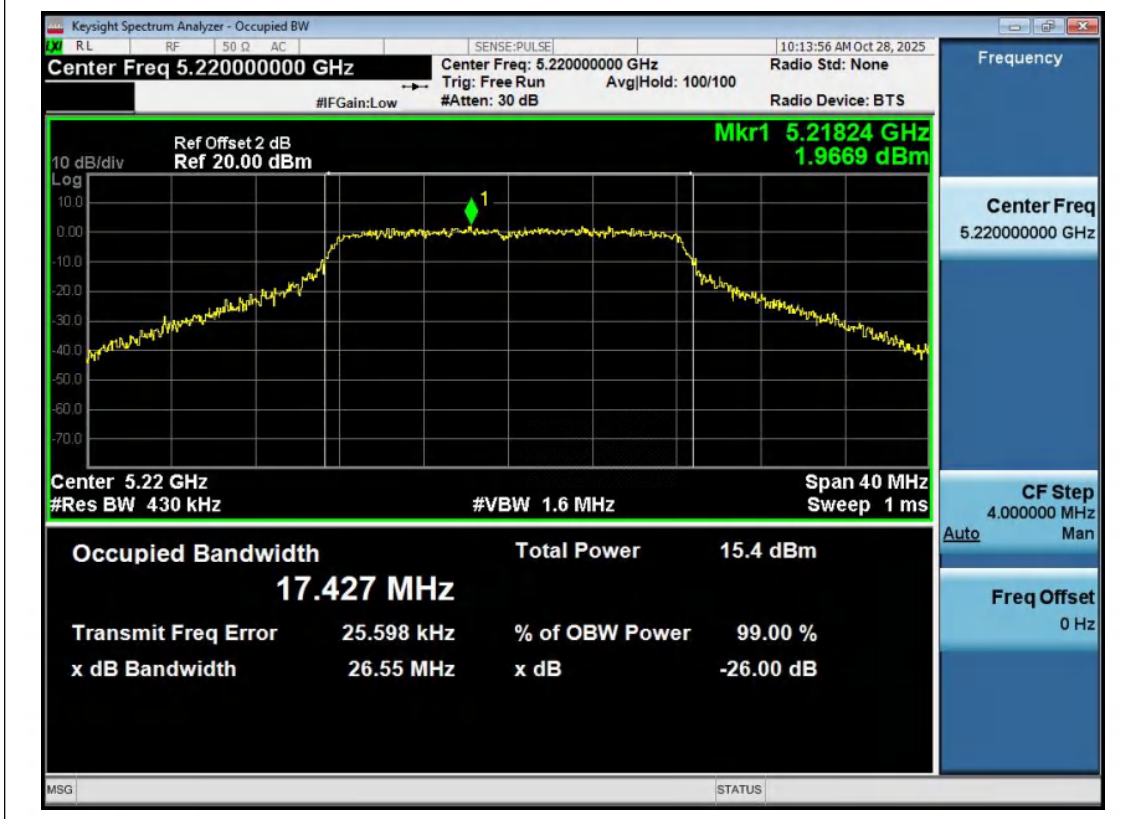


11A-Ant2-5220


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

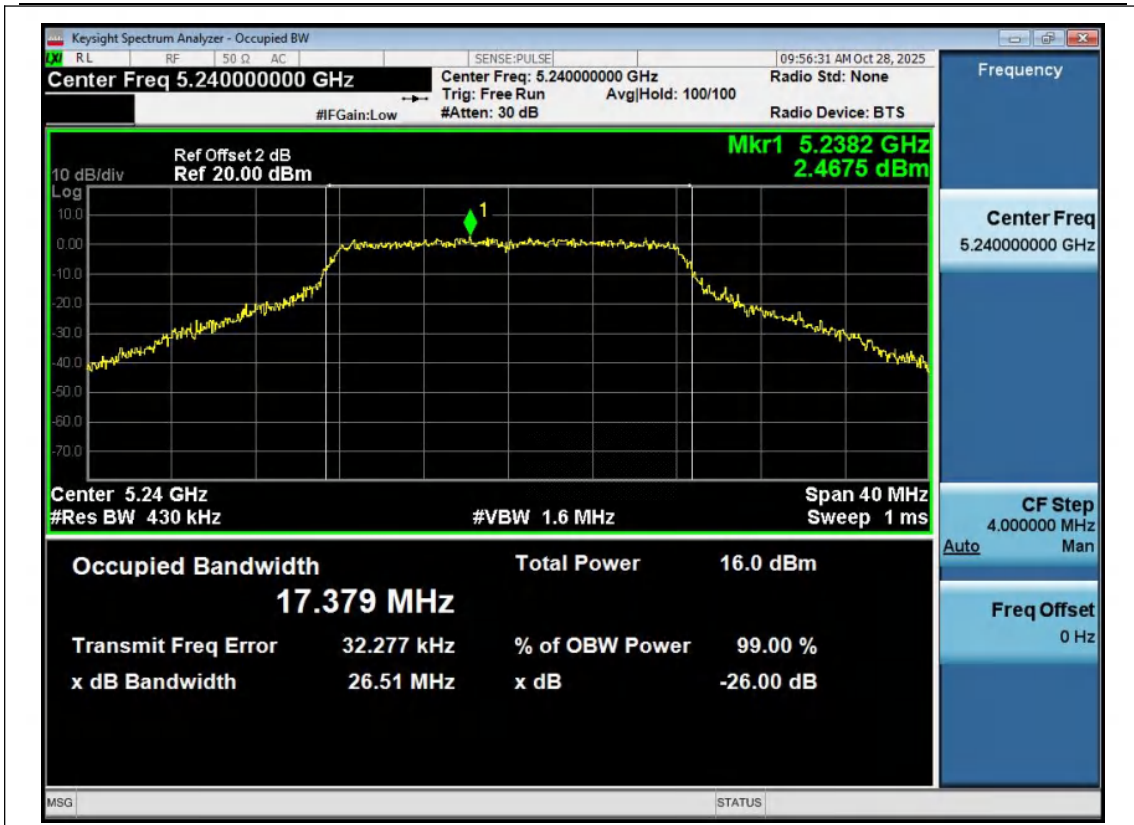

11A-Ant1-5240

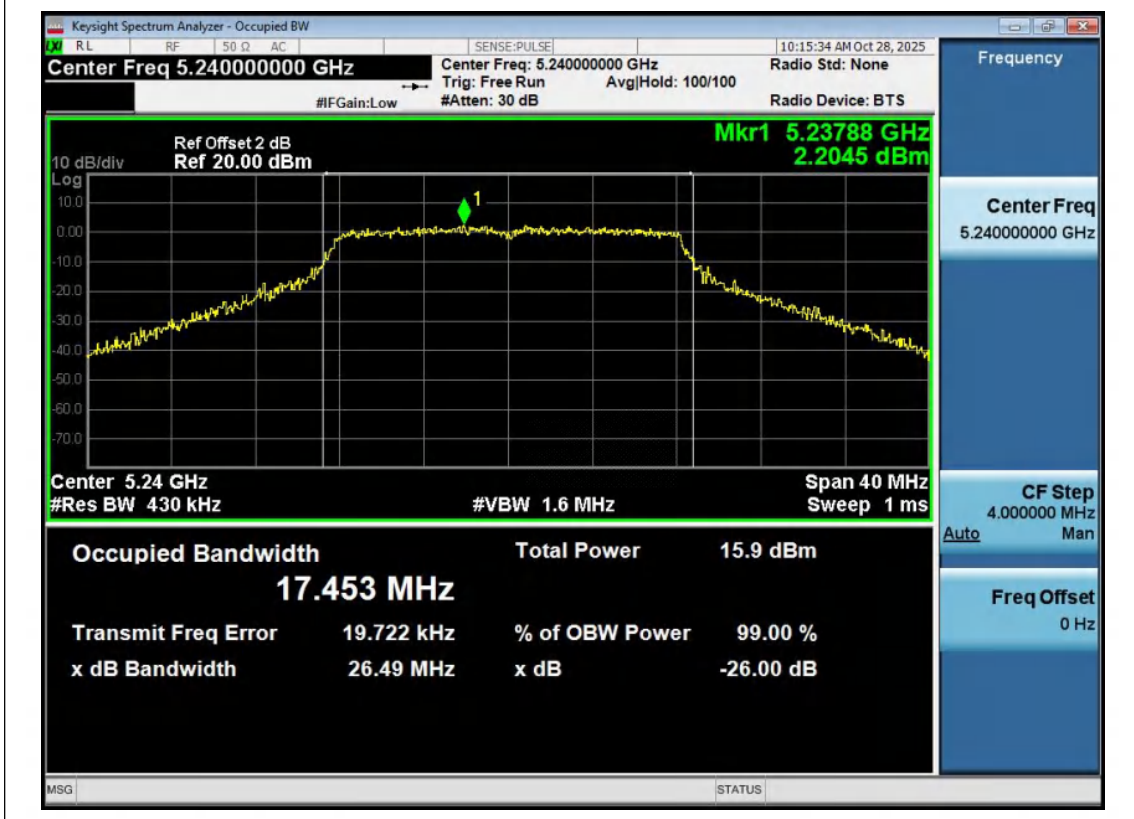


11A-Ant2-5240


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

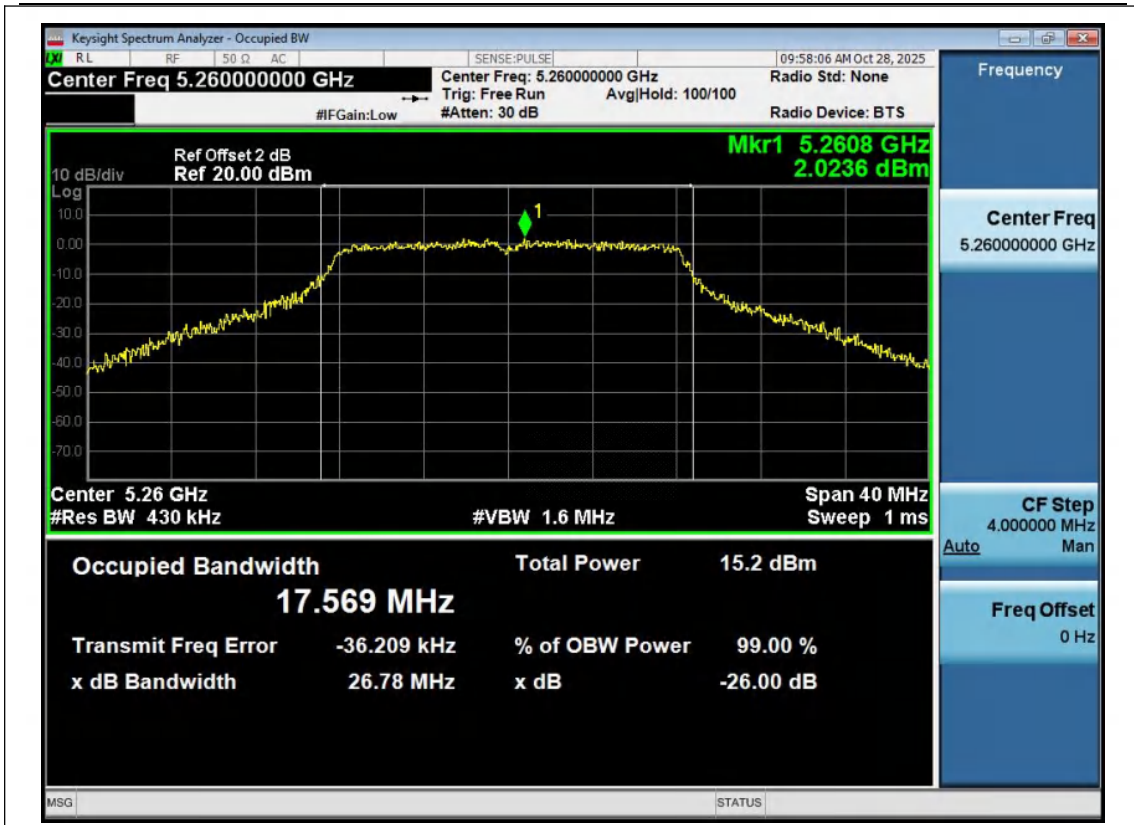

11A-Ant1-5260

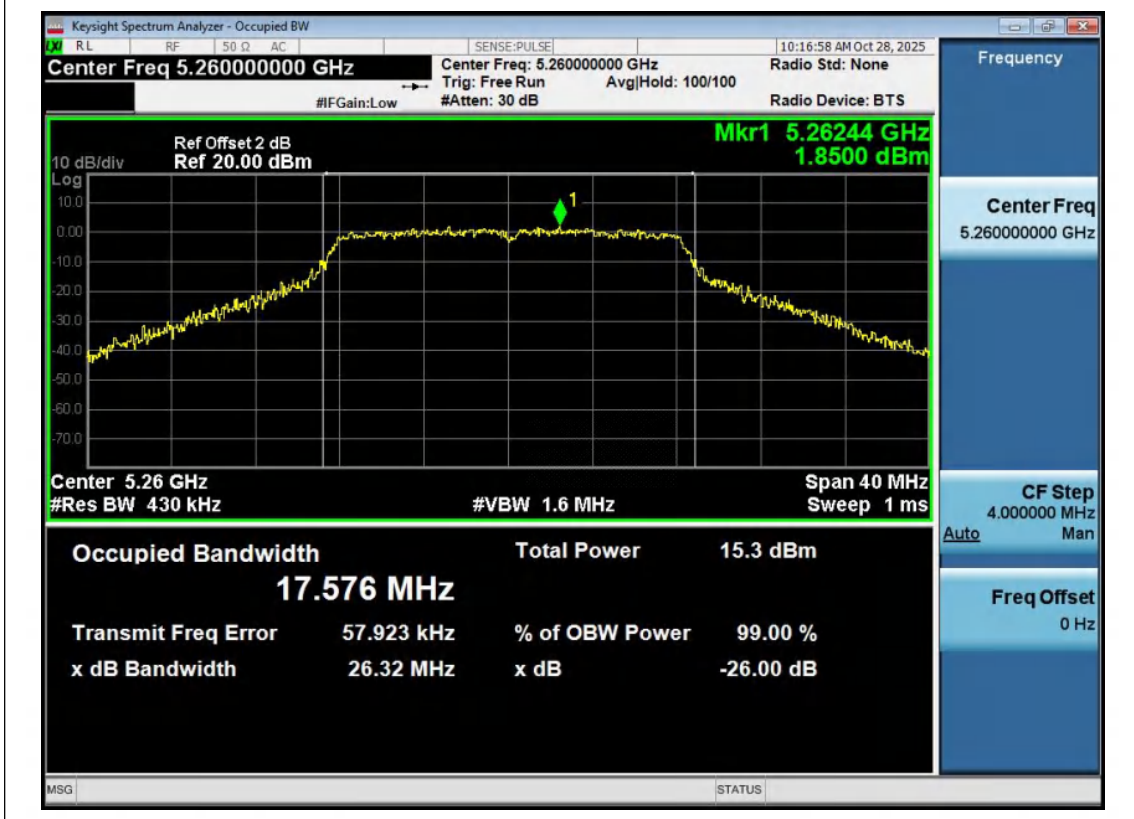

11A-Ant2-5260

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com