





Freq. Stability NVNT n40 5190MHz Ant1

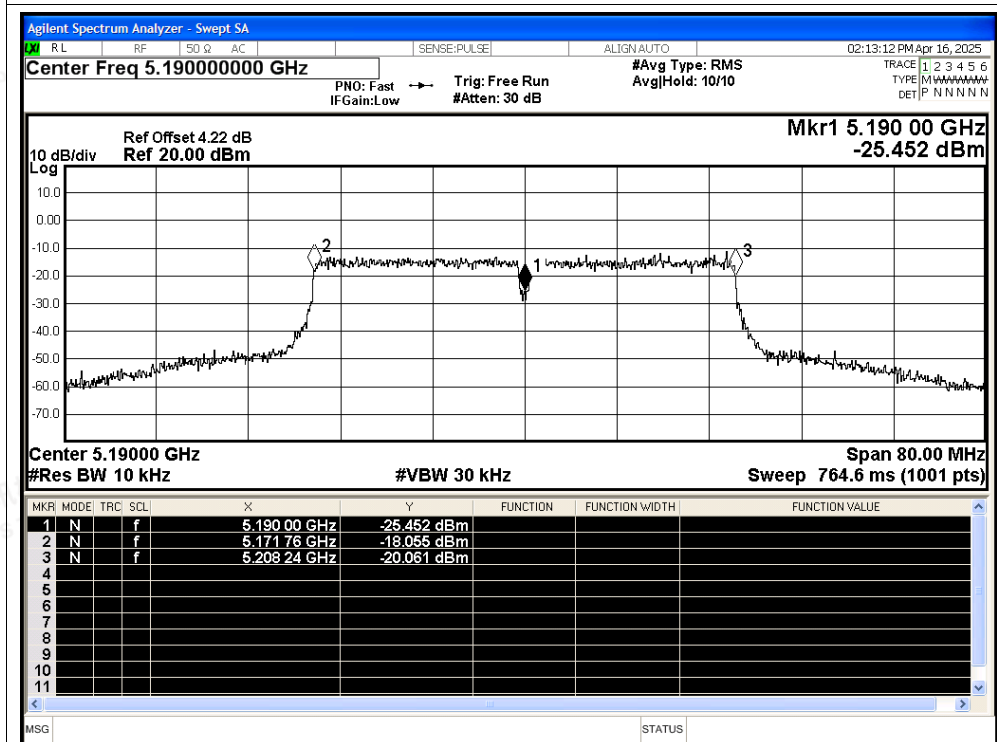


Freq. Stability NVNT n40 5230MHz Ant1

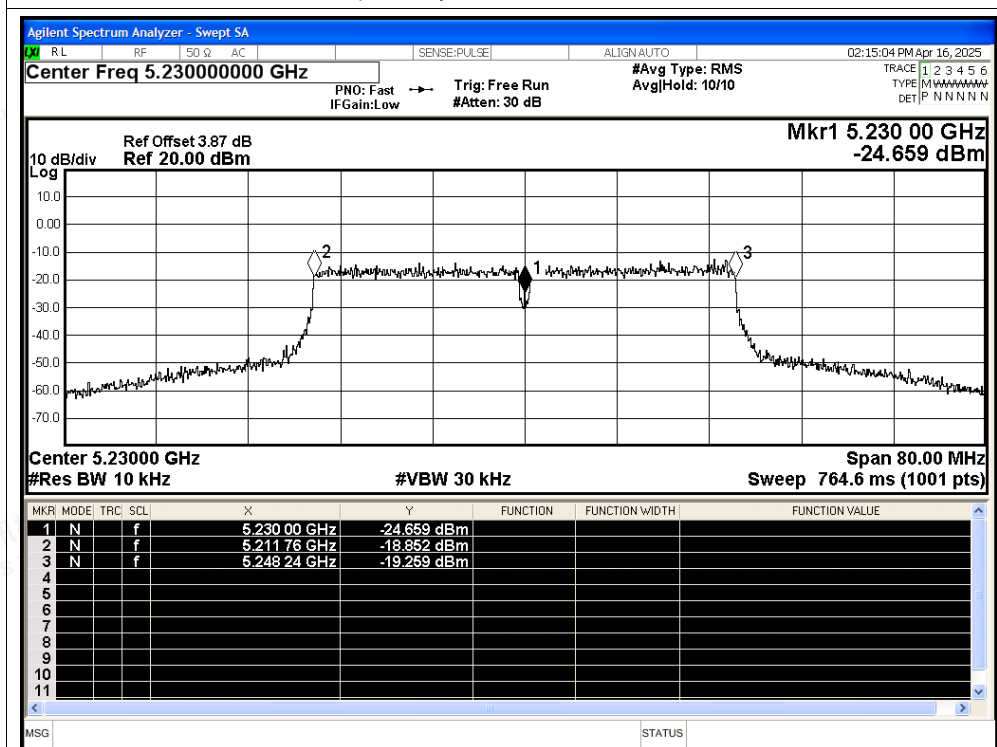




Freq. Stability NVNT ac20 5180MHz Ant1

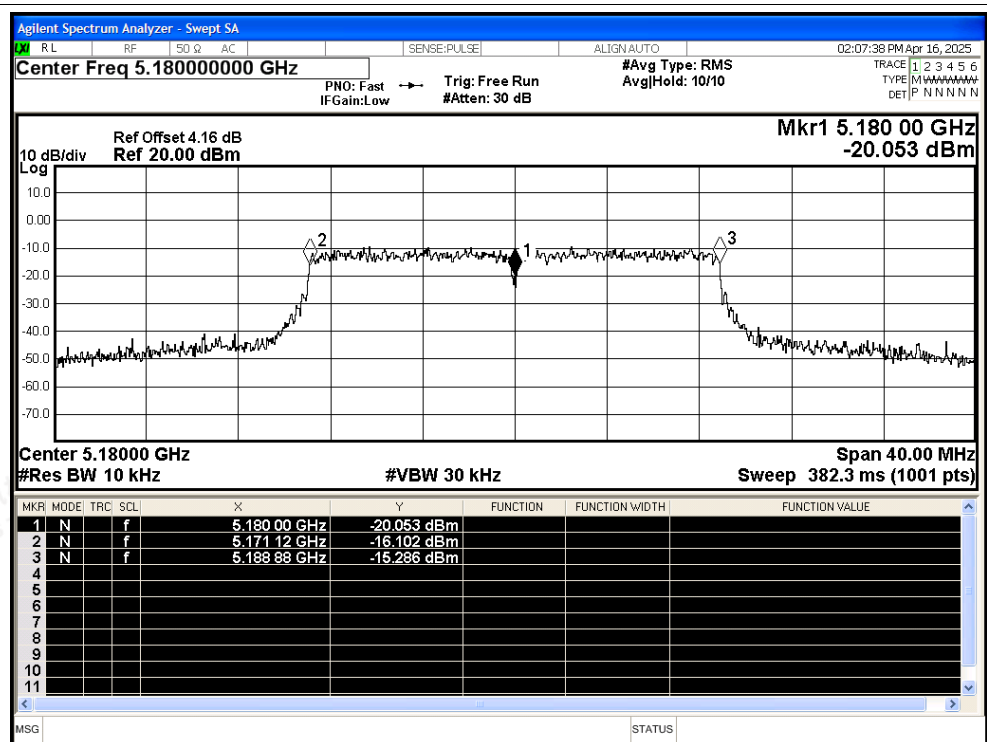


Freq. Stability NVNT ac20 5200MHz Ant1

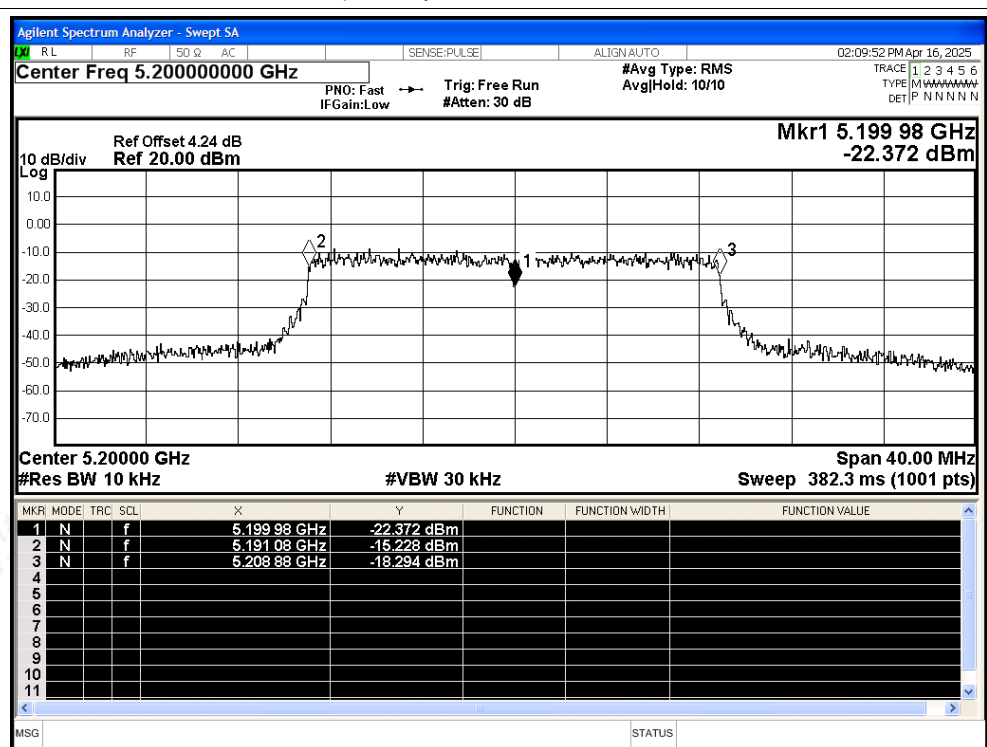




Freq. Stability NVNT ac20 5240MHz Ant1

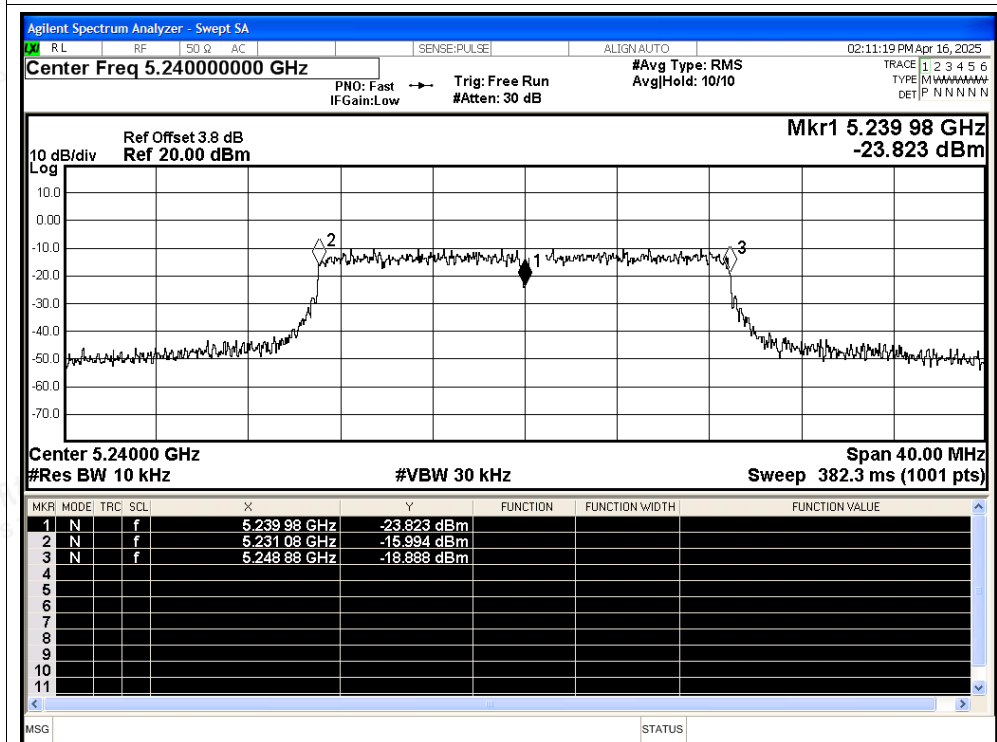


Freq. Stability NVNT ac40 5190MHz Ant1

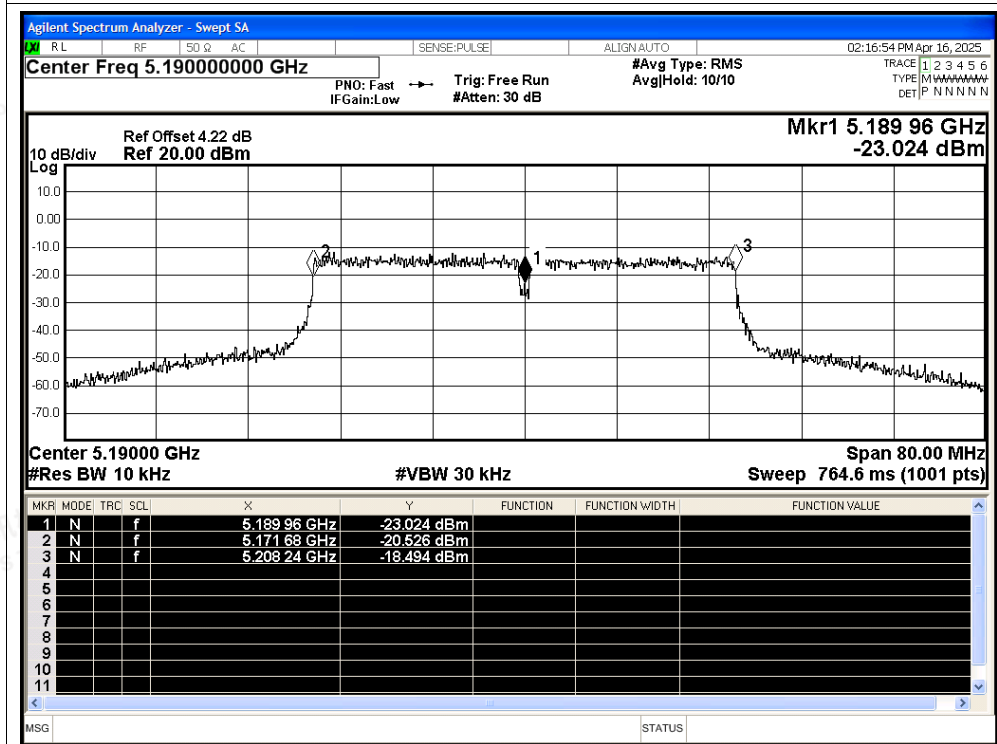





Freq. Stability NVNT ac40 5230MHz Ant1

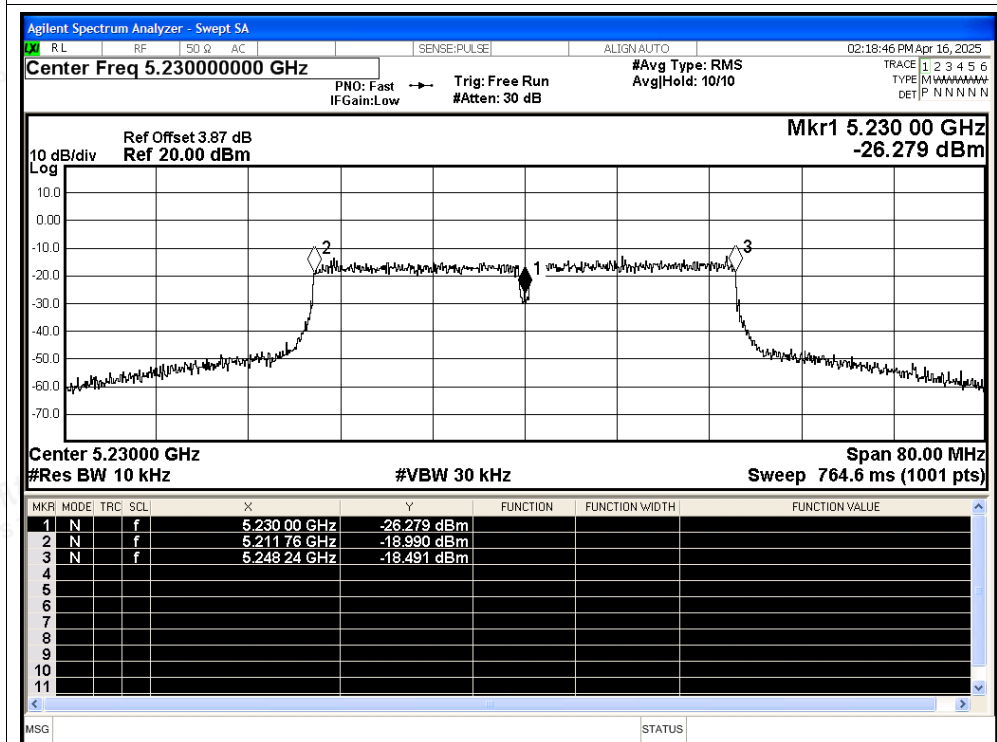

Freq. Stability NVNT ac80 5210MHz Ant1

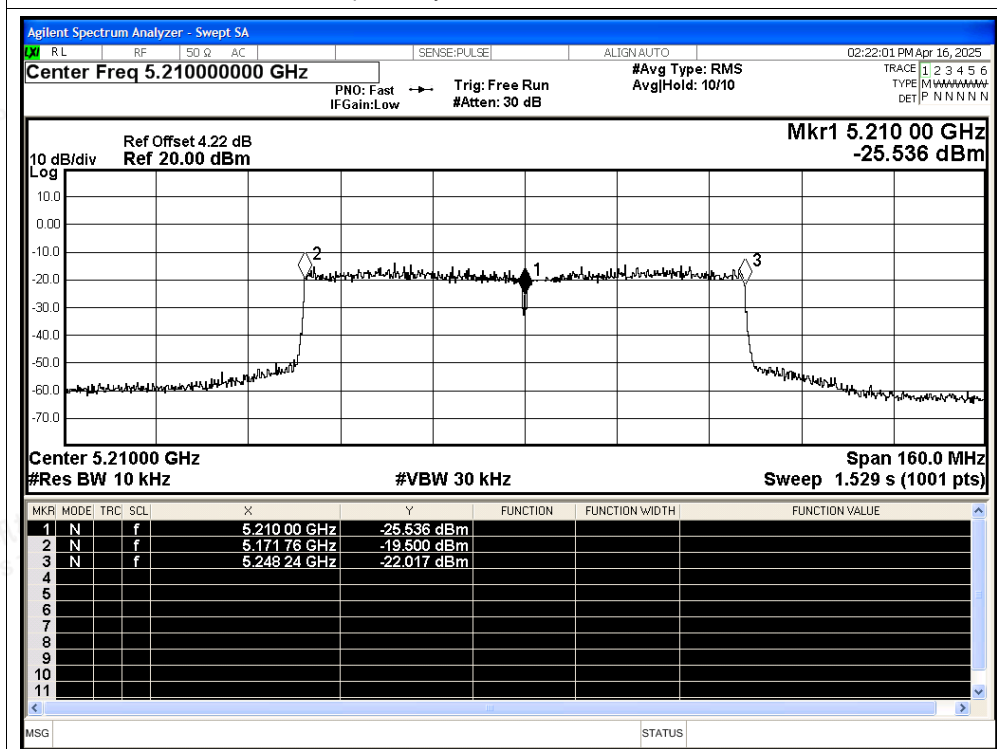

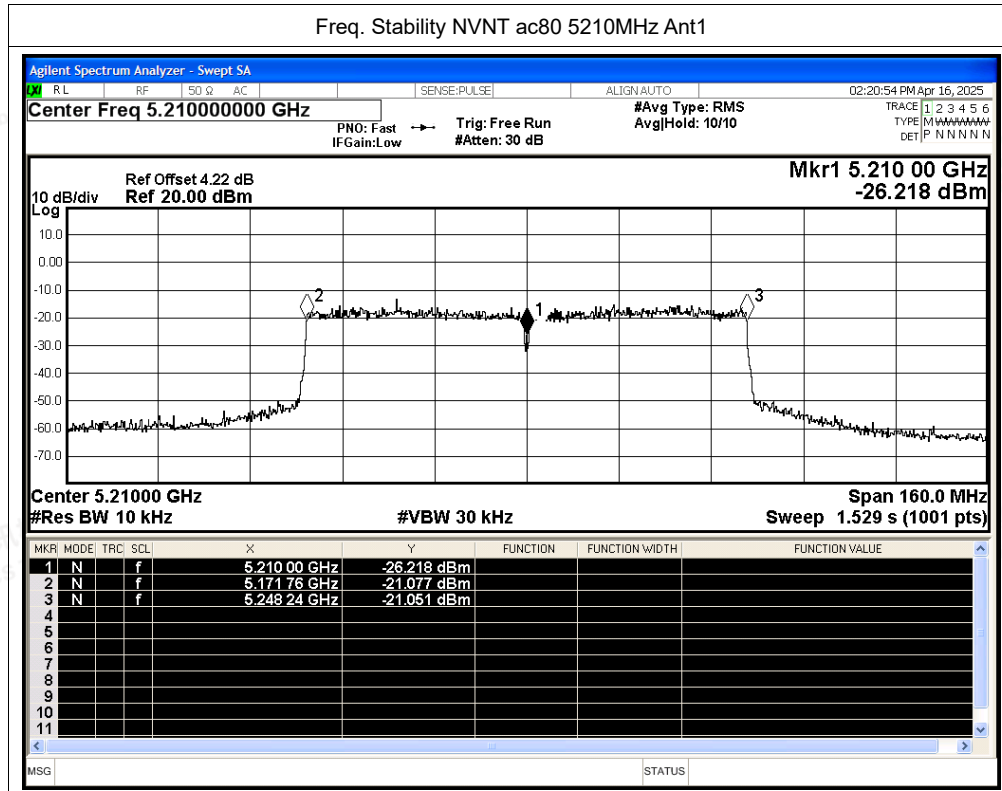

Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	n20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant2	5190	0	0	25	Pass
NVNT	n40	5230	Ant2	5230	0	0	25	Pass
NVNT	ac20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
NVNT	ac40	5230	Ant2	5230	0	0	25	Pass
NVNT	ac80	5210	Ant2	5210	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5180MHz Ant2

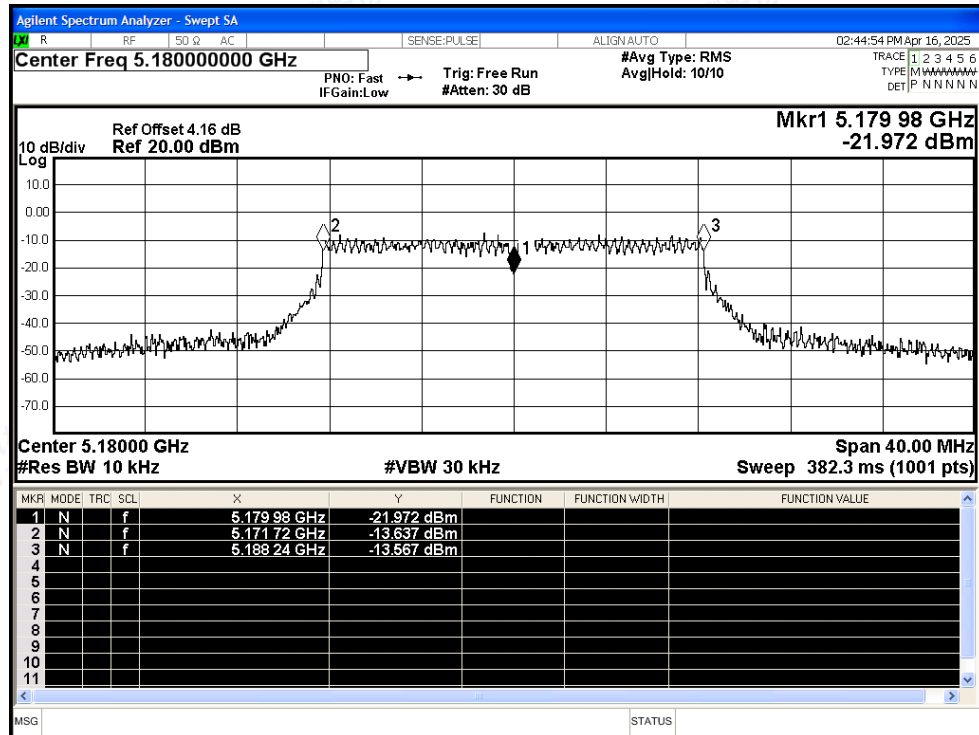


Freq. Stability NVNT a 5200MHz Ant2

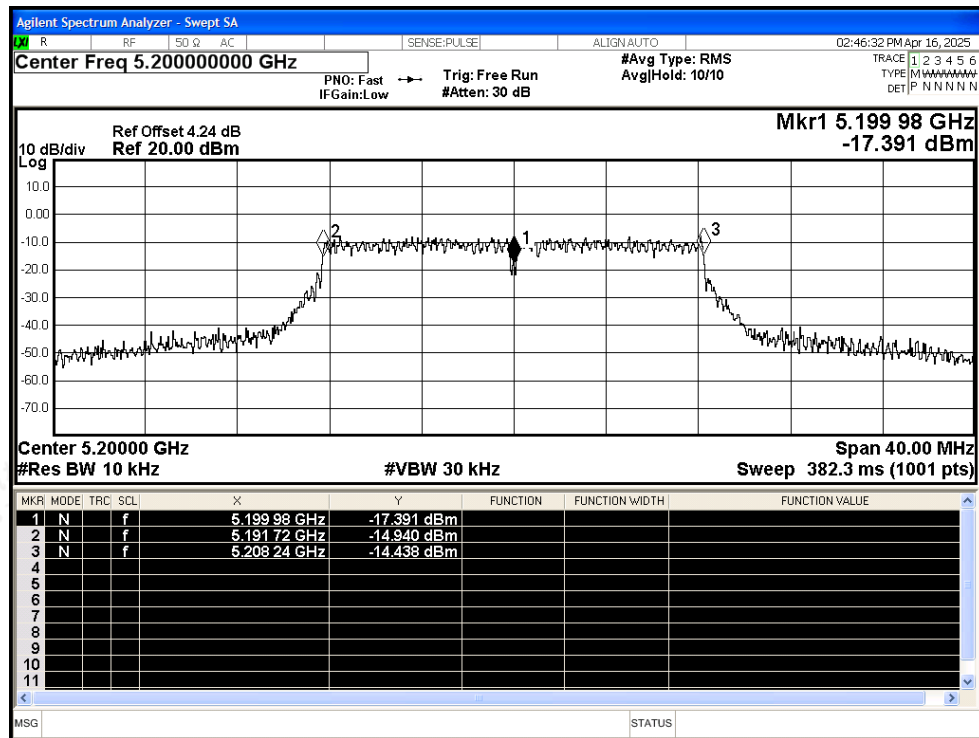




Freq. Stability NVNT a 5240MHz Ant2

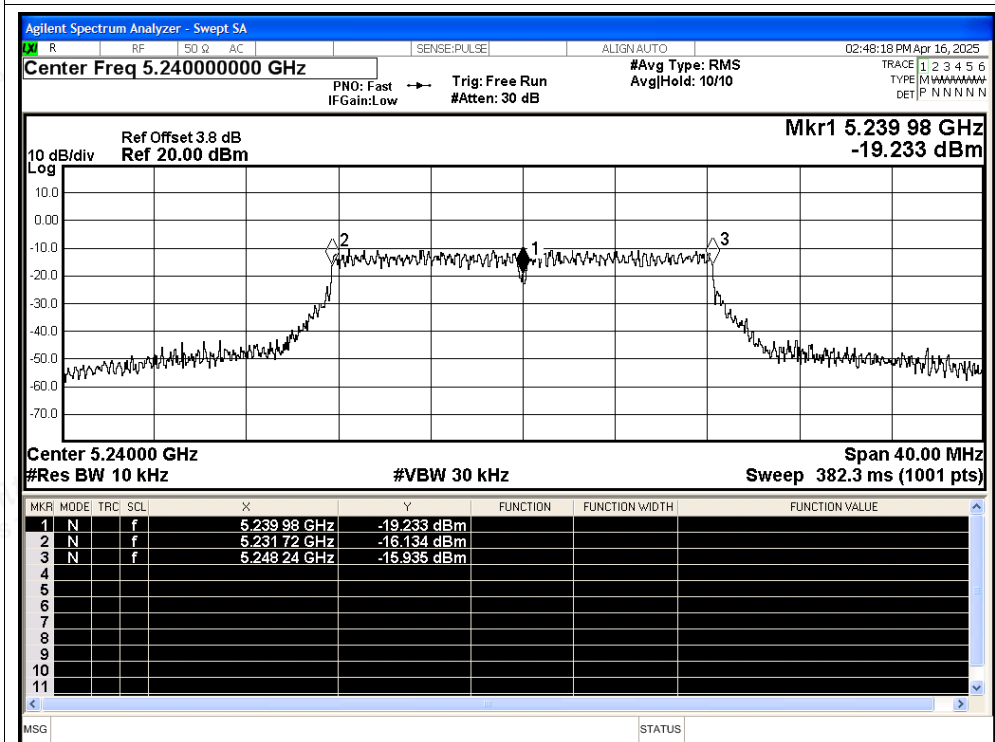


Freq. Stability NVNT n20 5180MHz Ant2

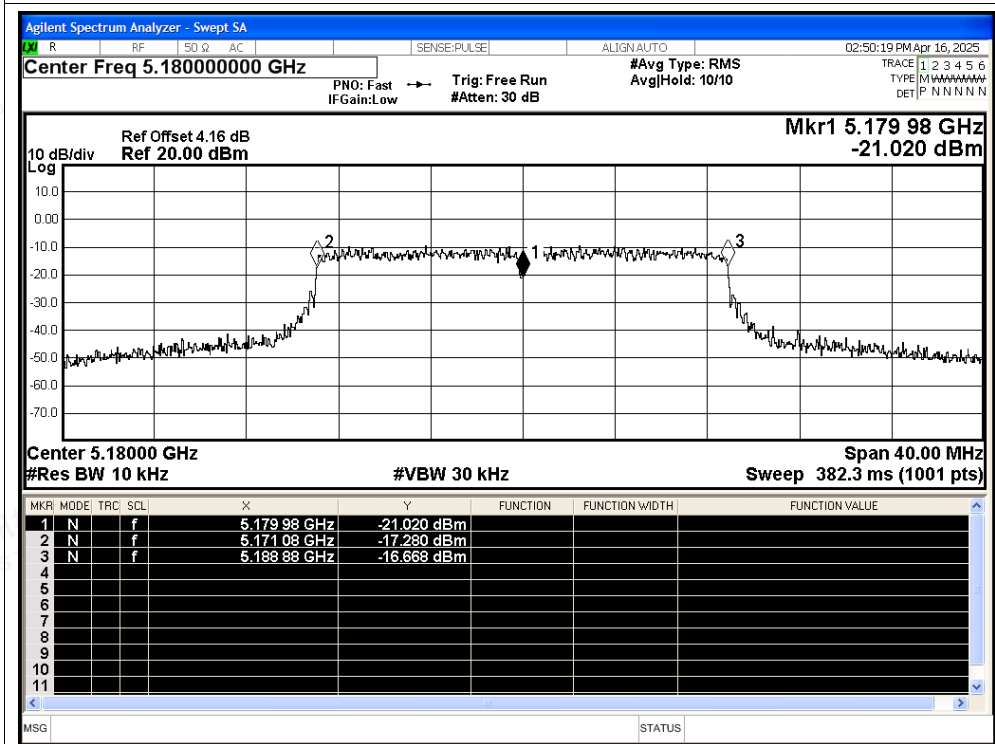




Freq. Stability NVNT n20 5200MHz Ant2

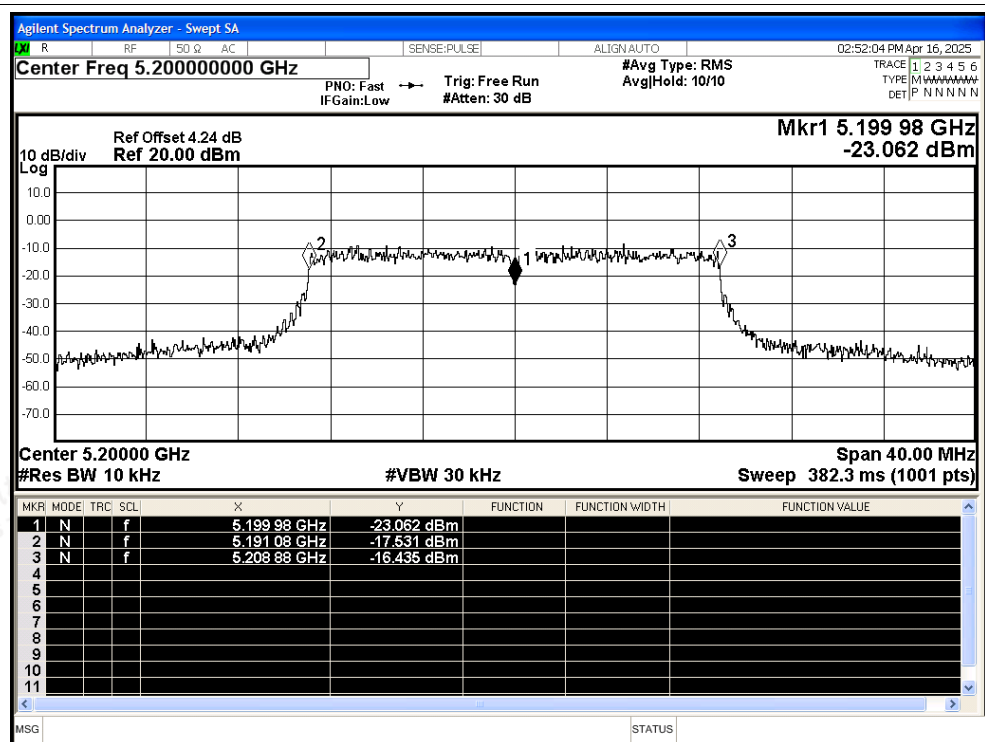


Freq. Stability NVNT n20 5240MHz Ant2

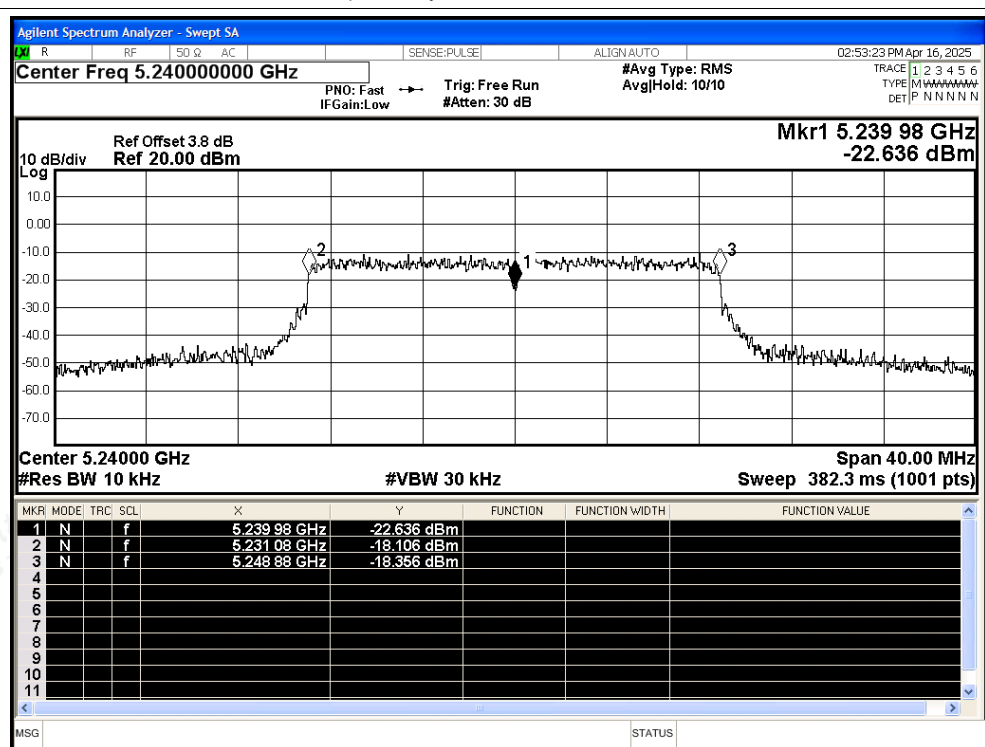






Freq. Stability NVNT n40 5190MHz Ant2

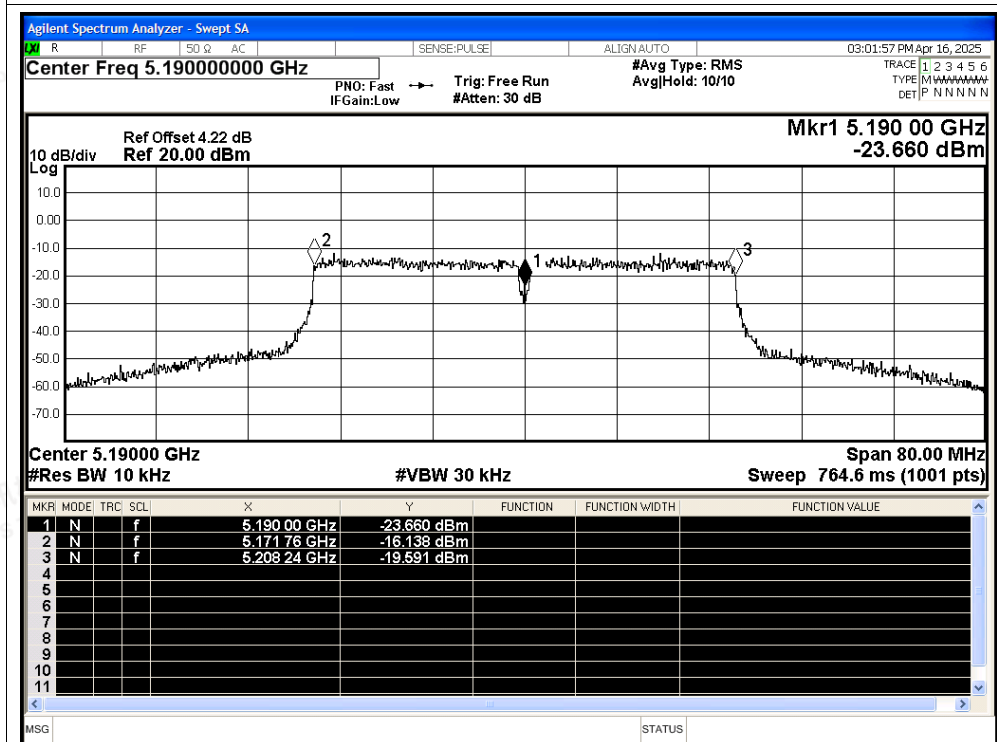

Freq. Stability NVNT n40 5230MHz Ant2

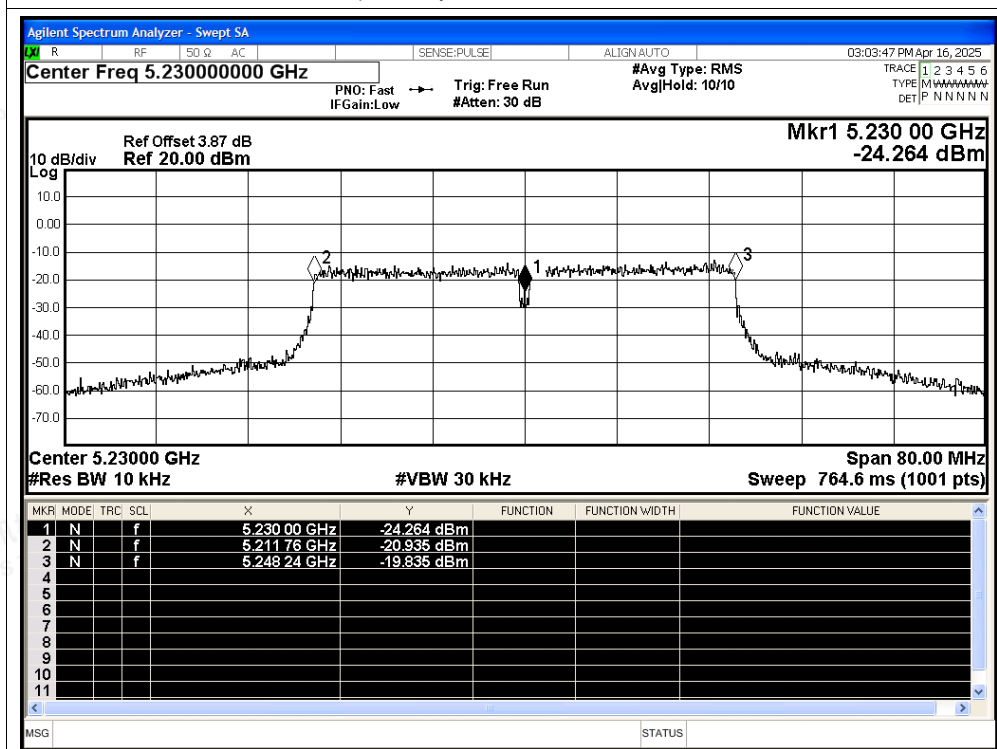


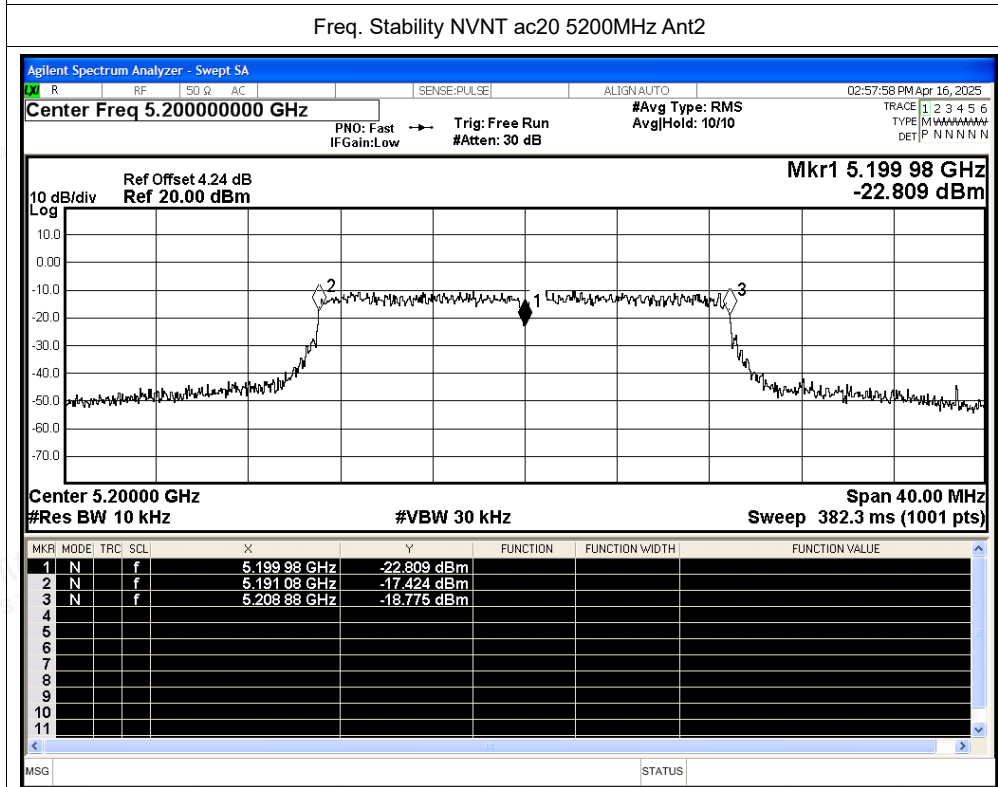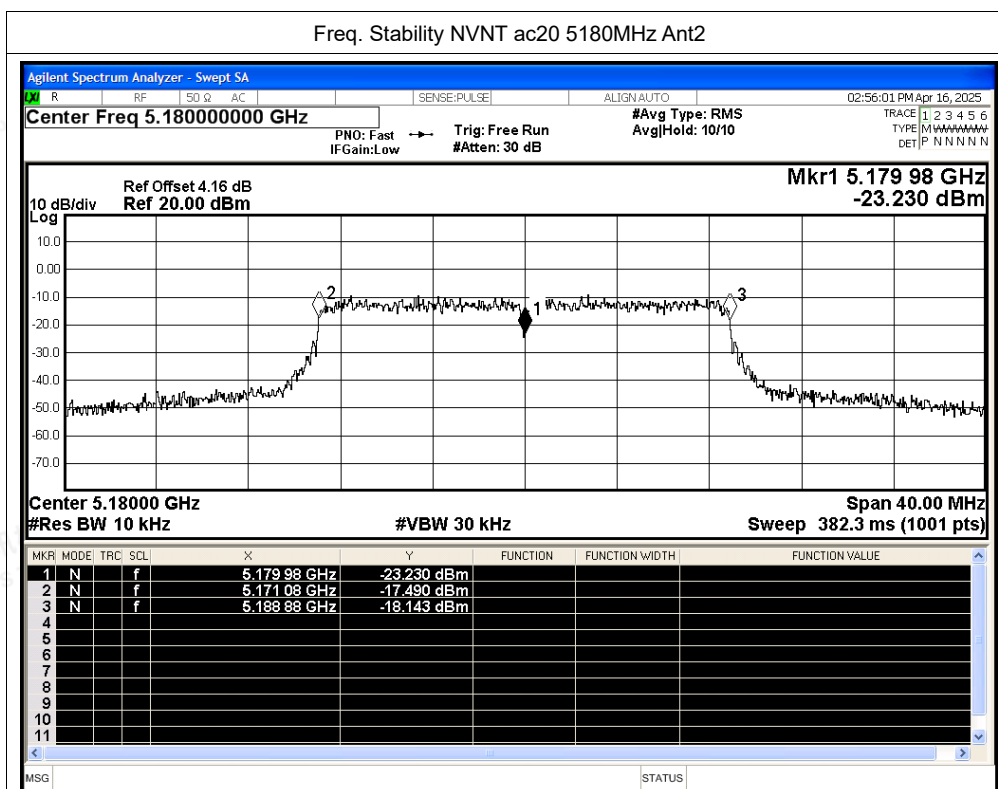


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Freq. Stability NVNT ac20 5240MHz Ant2

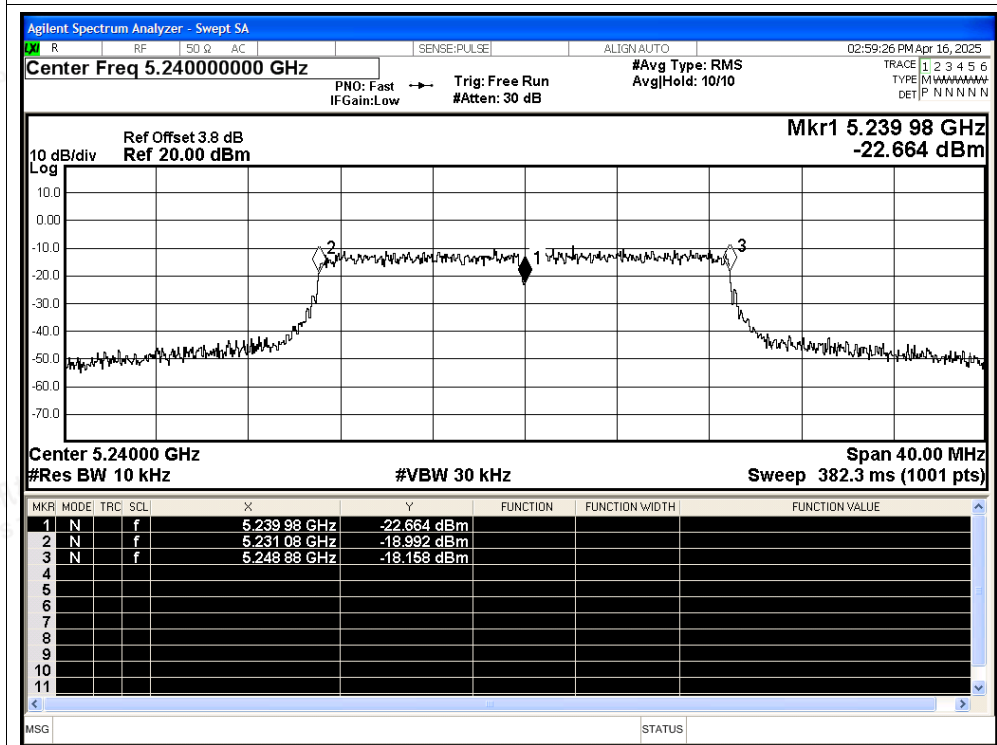


Freq. Stability NVNT ac40 5190MHz Ant2

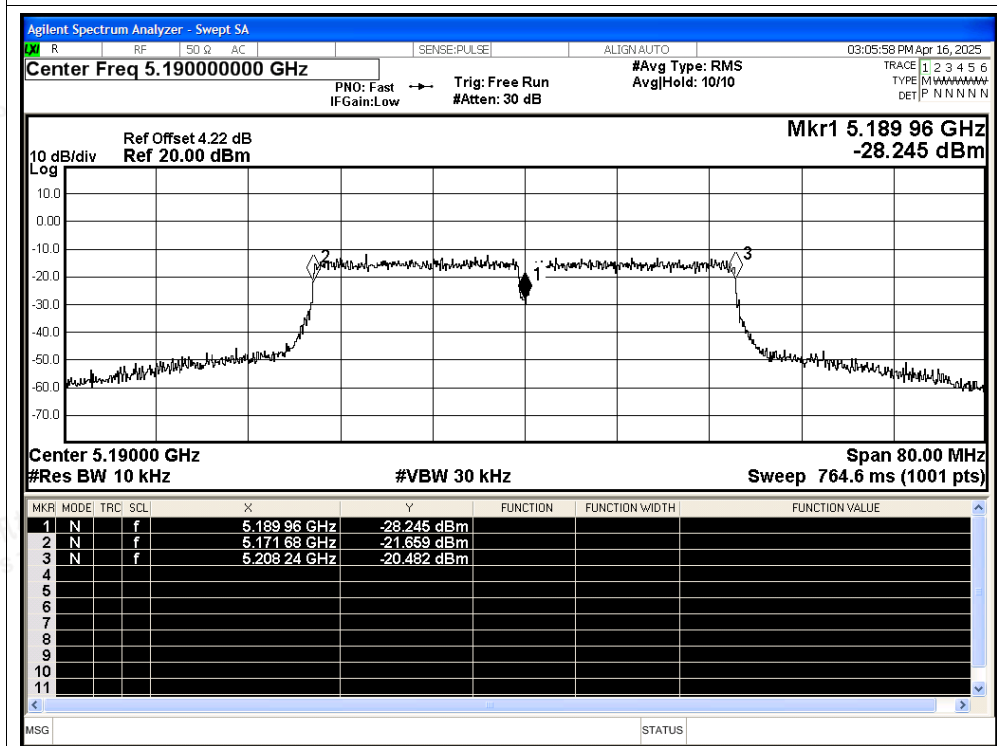





Freq. Stability NVNT ac40 5230MHz Ant2

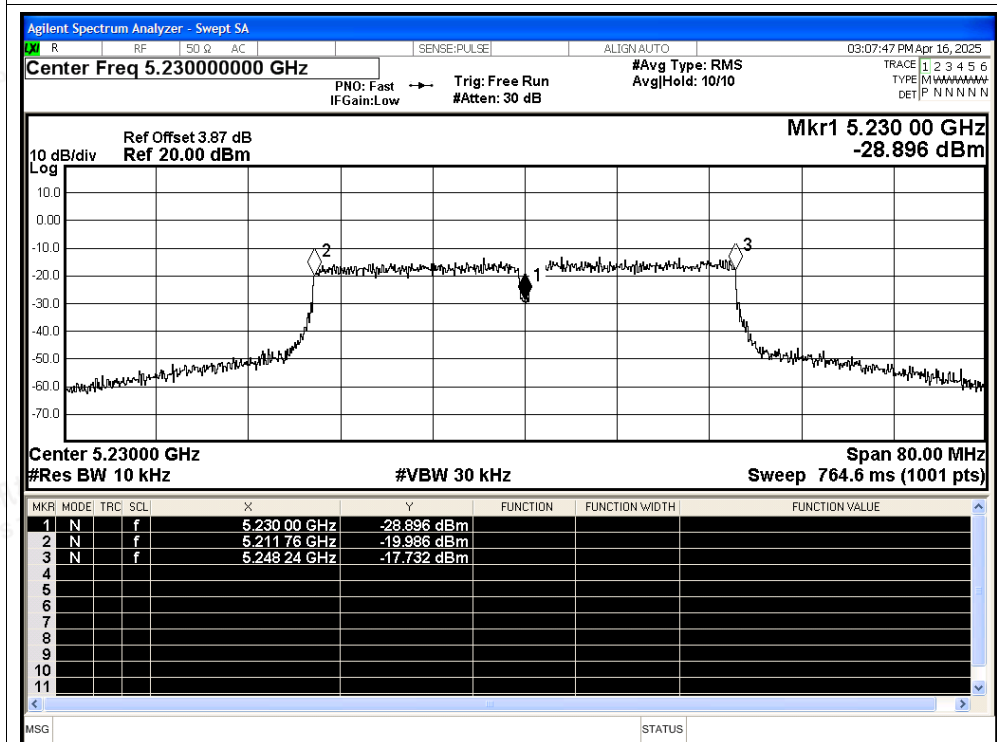

Freq. Stability NVNT ac80 5210MHz Ant2

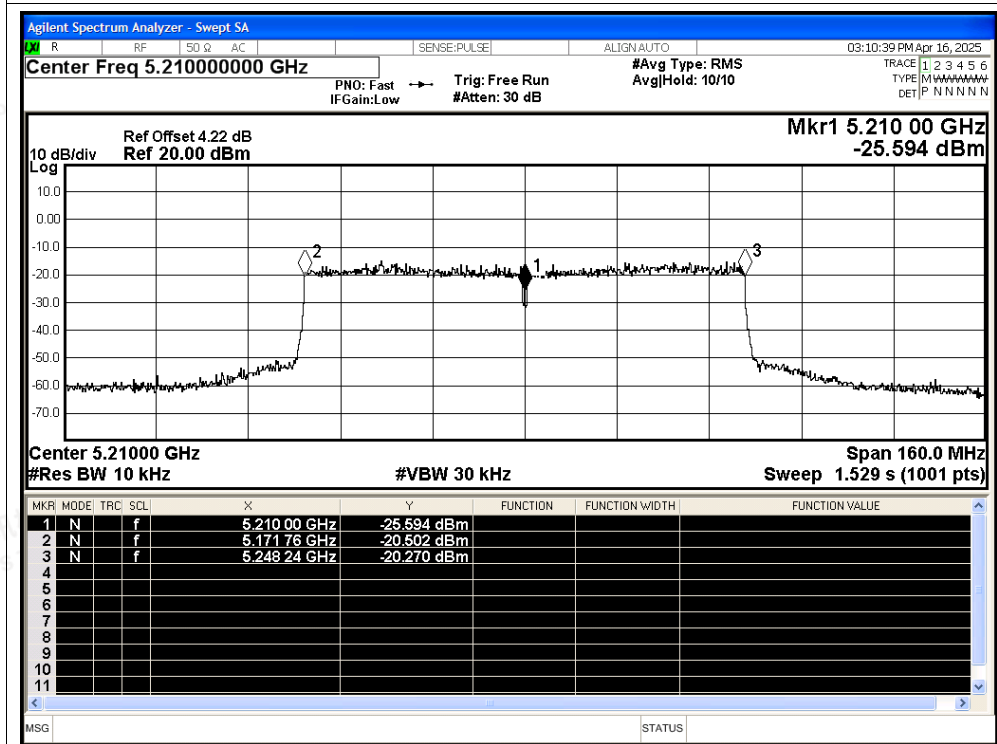

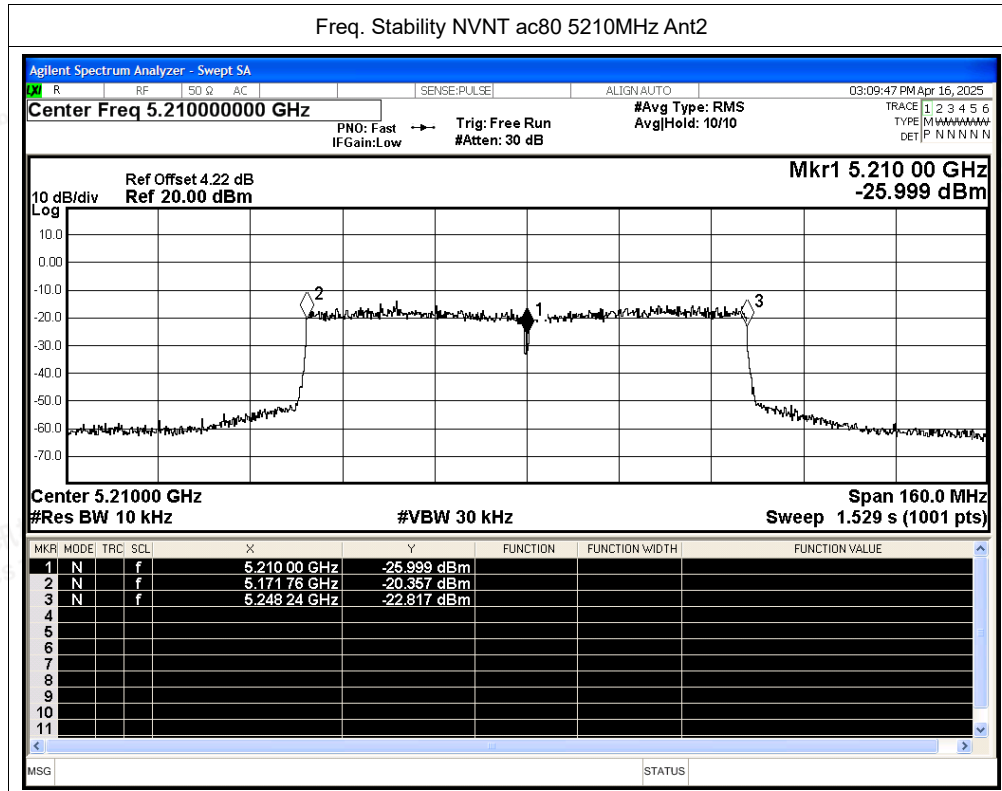



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant3	5180	0	0	25	Pass
NVNT	a	5200	Ant3	5200	0	0	25	Pass
NVNT	a	5240	Ant3	5239.98	-20000	-3.82	25	Pass
NVNT	n20	5180	Ant3	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant3	5200	0	0	25	Pass
NVNT	n20	5240	Ant3	5240	0	0	25	Pass
NVNT	n40	5190	Ant3	5189.96	-40000	-7.71	25	Pass
NVNT	n40	5230	Ant3	5230	0	0	25	Pass
NVNT	ac20	5180	Ant3	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant3	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant3	5240	0	0	25	Pass
NVNT	ac40	5190	Ant3	5190	0	0	25	Pass
NVNT	ac40	5230	Ant3	5230	0	0	25	Pass
NVNT	ac80	5210	Ant3	5210	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5180MHz Ant3

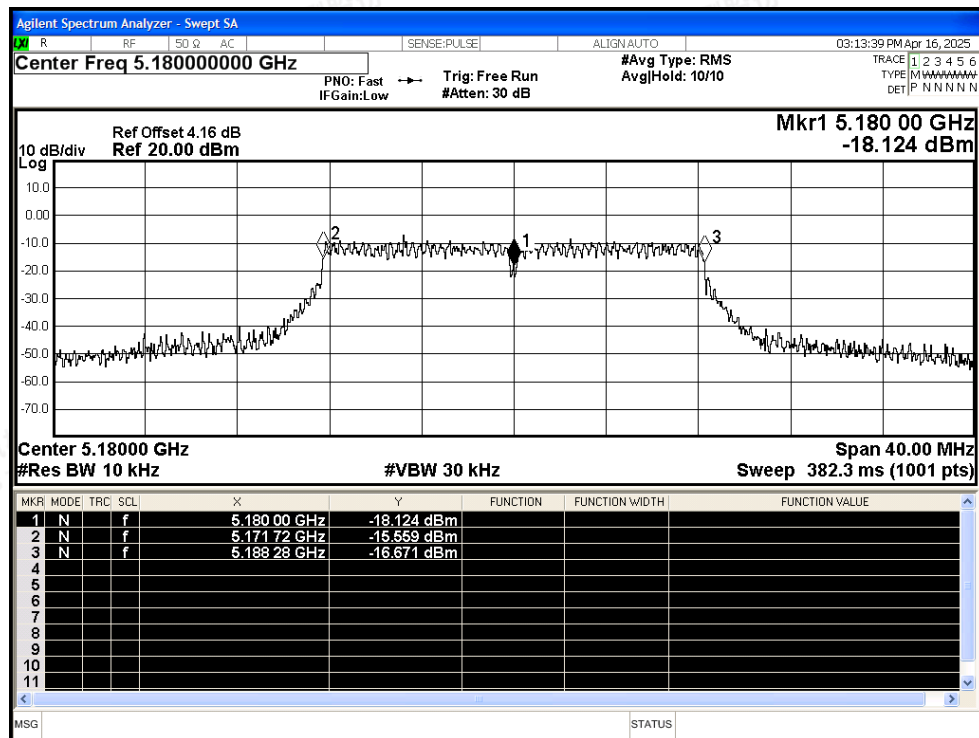


Freq. Stability NVNT a 5200MHz Ant3

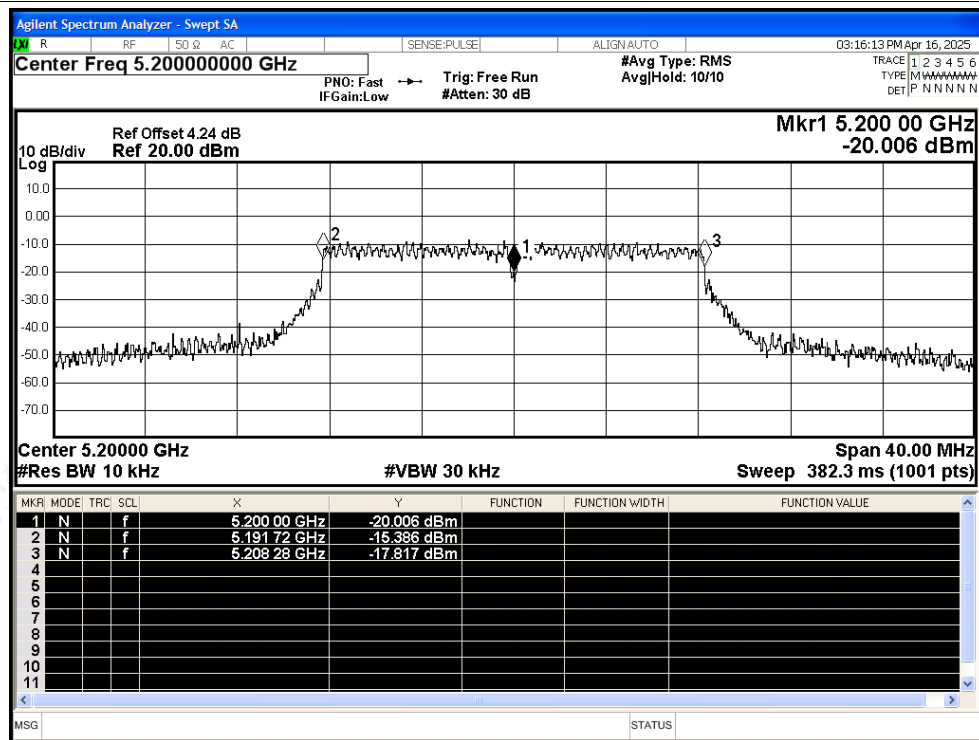


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant3

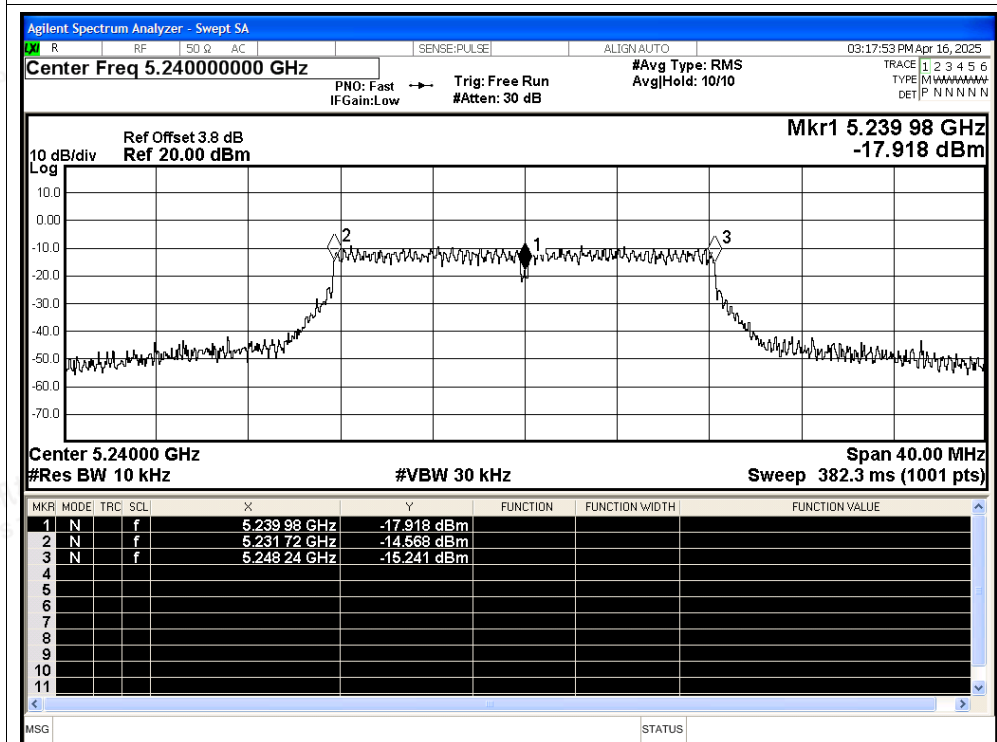


Freq. Stability NVNT n20 5180MHz Ant3

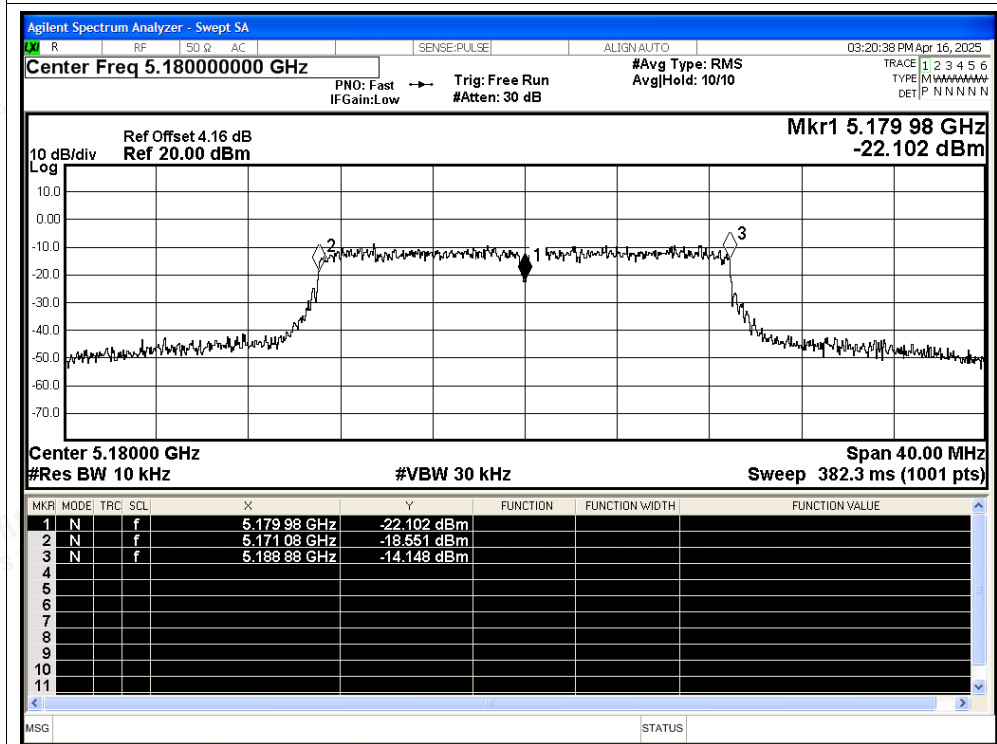




Freq. Stability NVNT n20 5200MHz Ant3

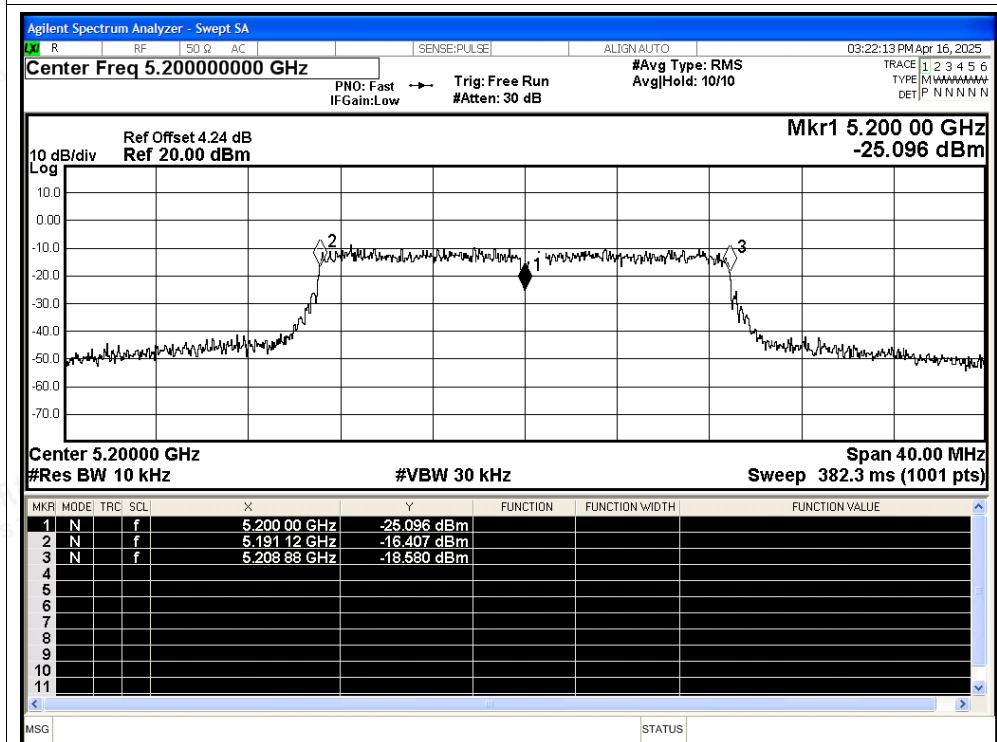


Freq. Stability NVNT n20 5240MHz Ant3

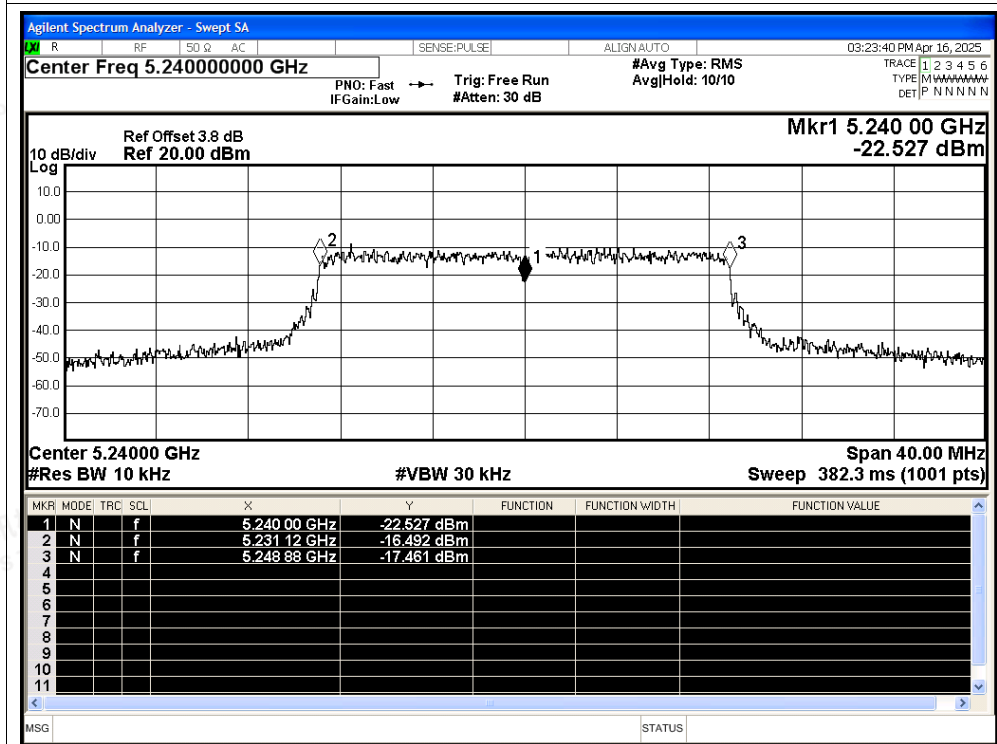




Freq. Stability NVNT n40 5190MHz Ant3

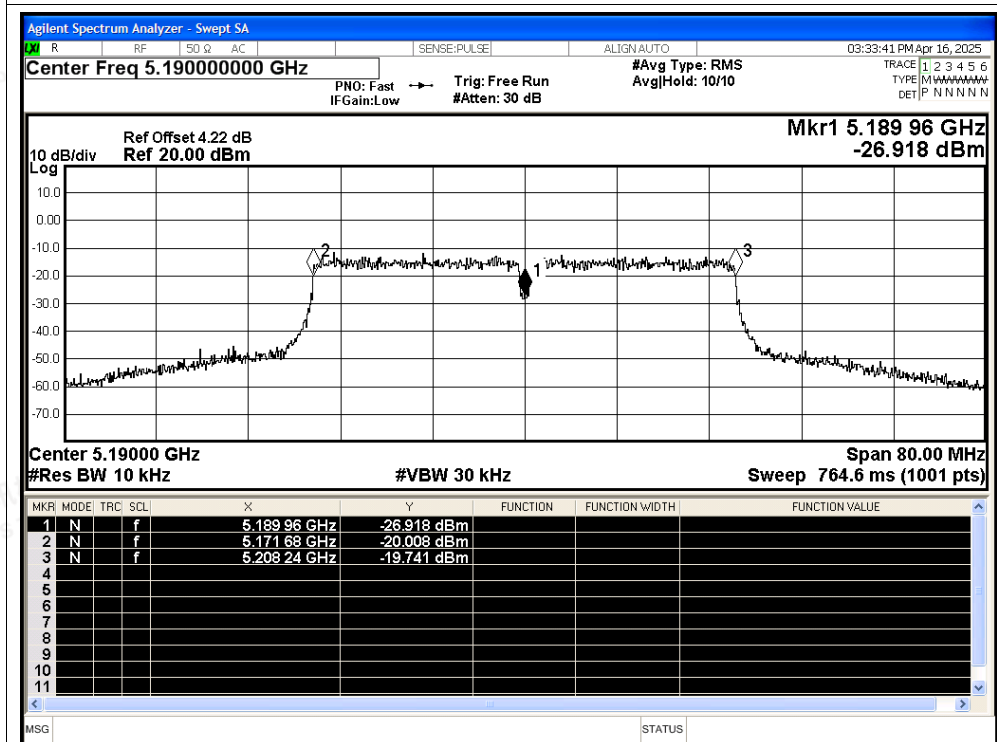


Freq. Stability NVNT n40 5230MHz Ant3

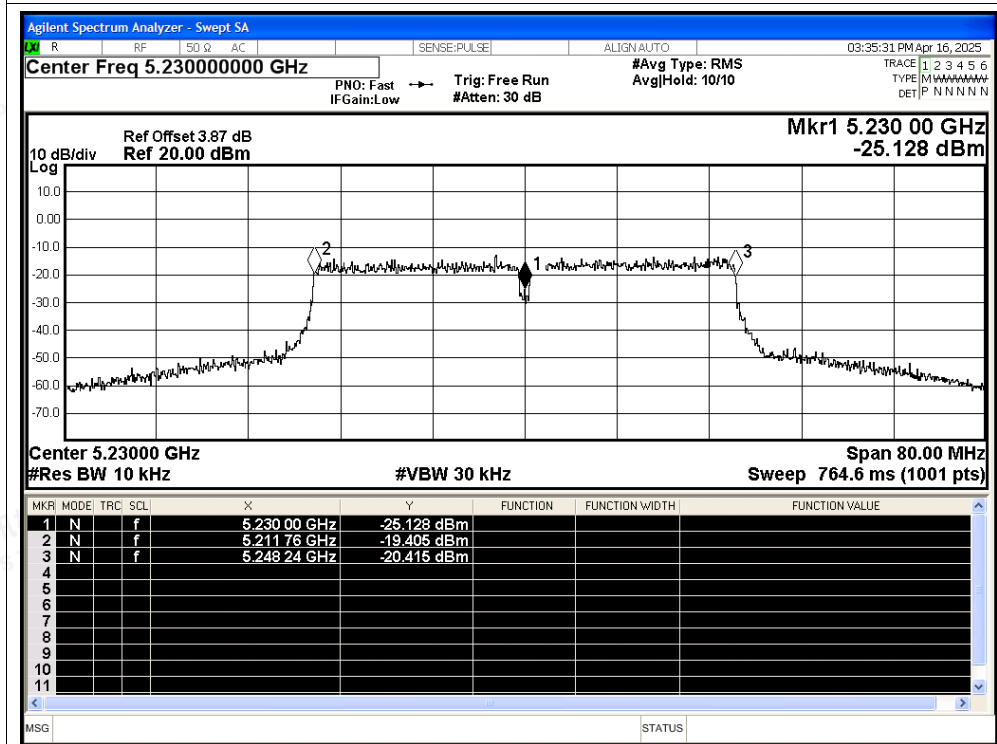




Freq. Stability NVNT ac20 5180MHz Ant3

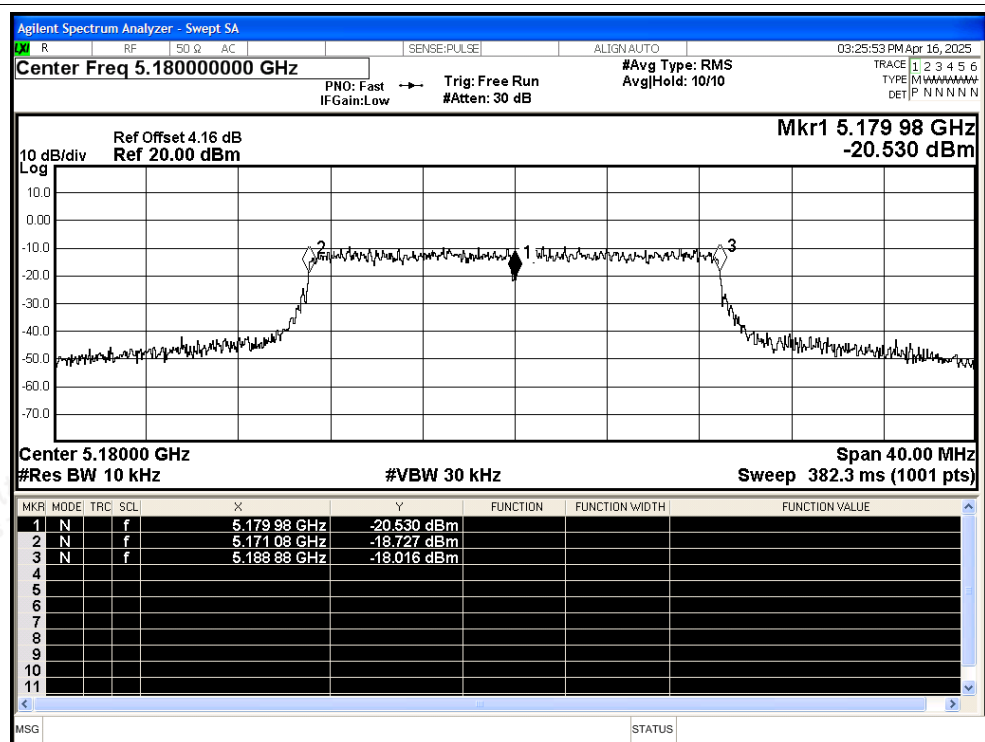


Freq. Stability NVNT ac20 5200MHz Ant3

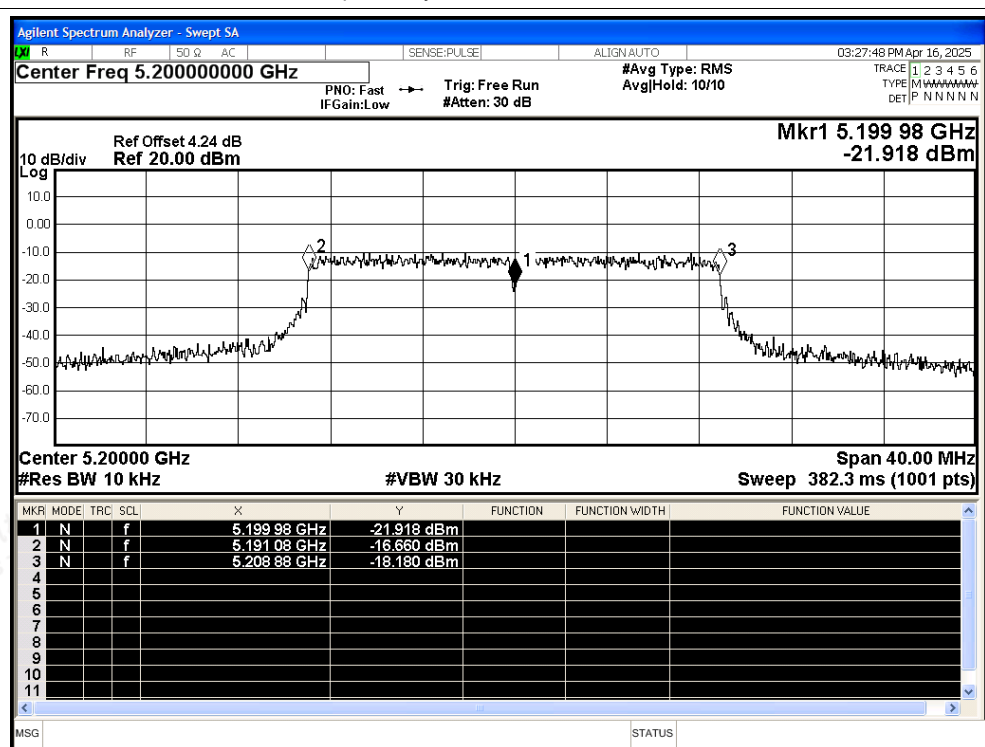




Freq. Stability NVNT ac20 5240MHz Ant3

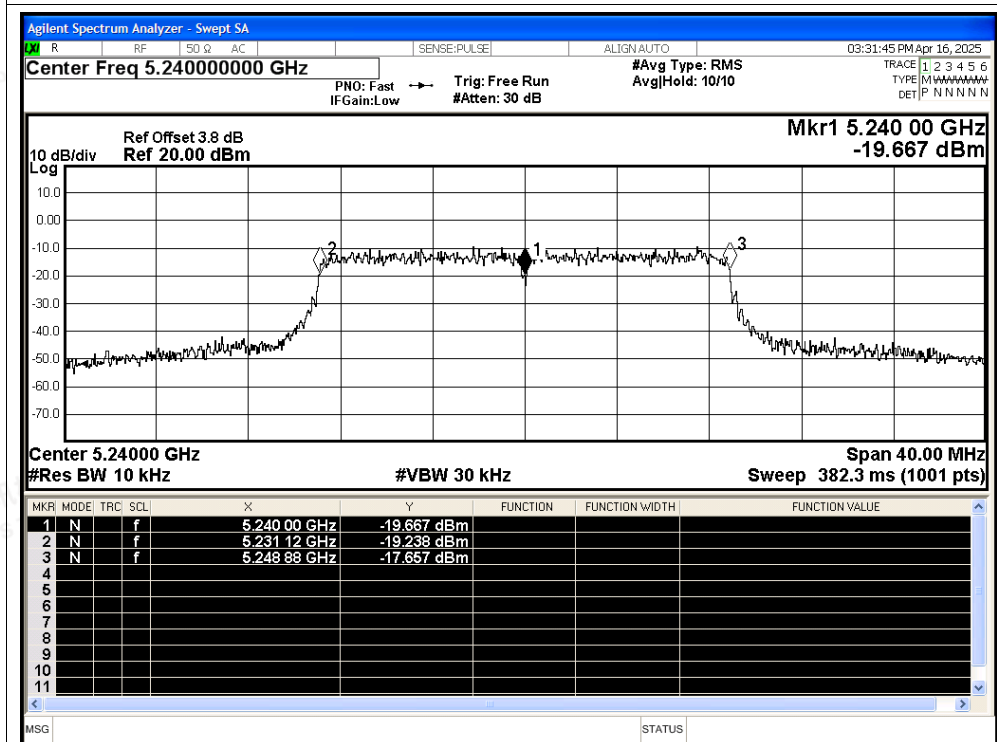


Freq. Stability NVNT ac40 5190MHz Ant3

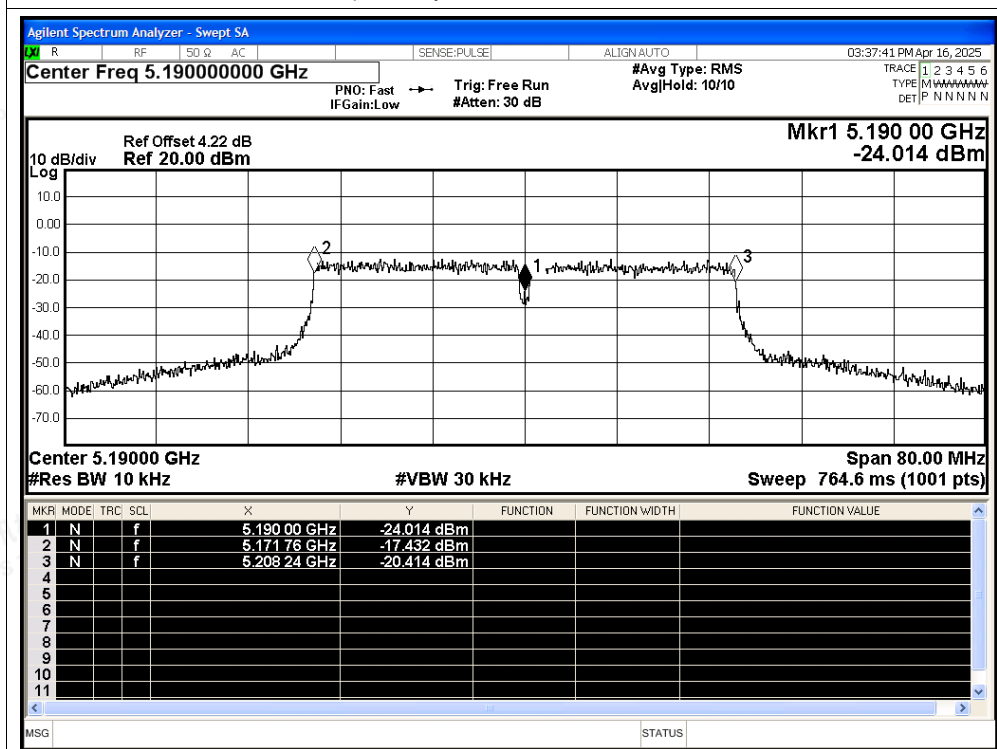





Freq. Stability NVNT ac40 5230MHz Ant3

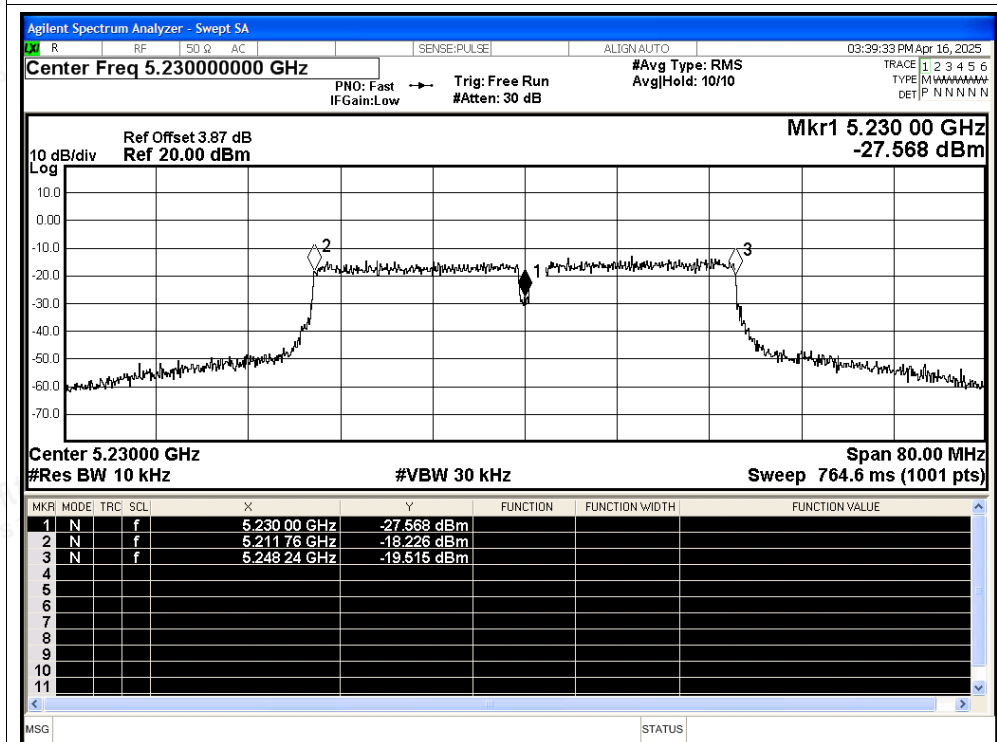

Freq. Stability NVNT ac80 5210MHz Ant3

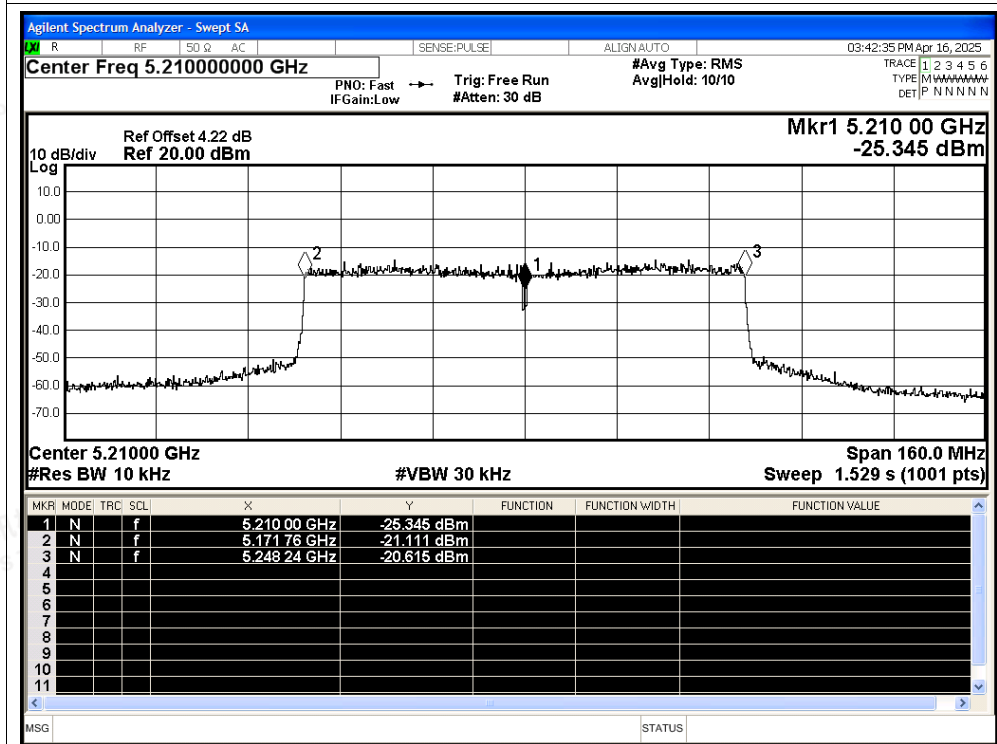

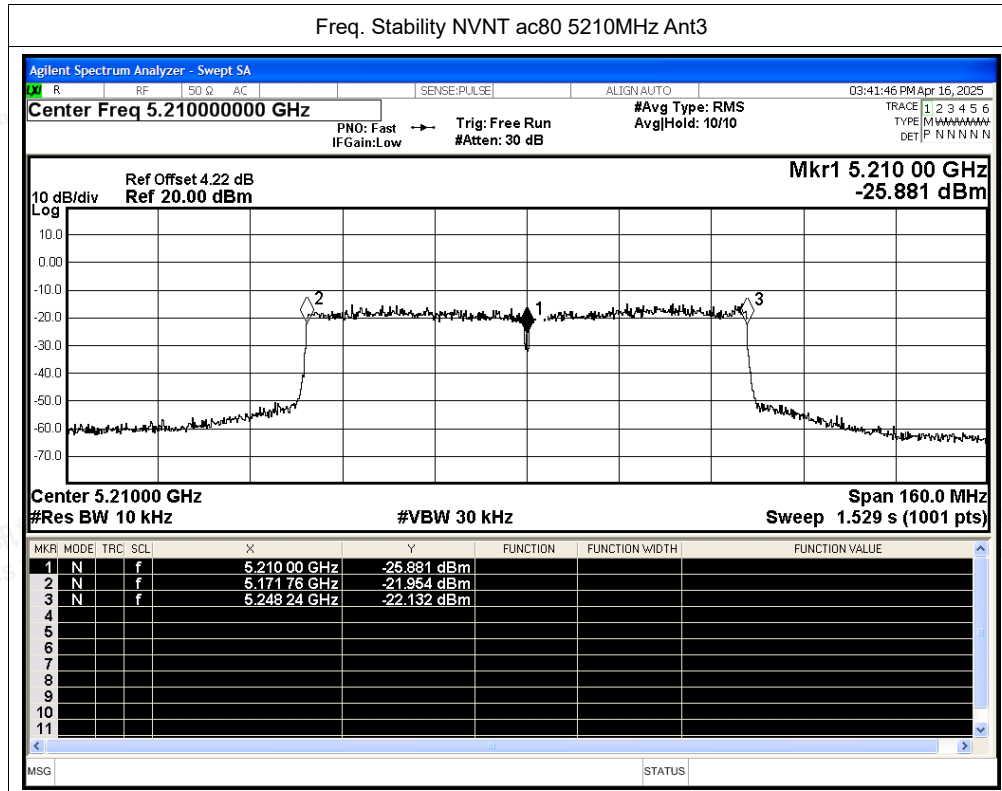



D.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant1	94.65	0.24	0.91
NVNT	a	5200	Ant1	94.65	0.24	0.91
NVNT	a	5240	Ant1	94.56	0.24	0.91
NVNT	n20	5180	Ant1	97.29	0.12	0.44
NVNT	n20	5200	Ant1	97.33	0.12	0.44
NVNT	n20	5240	Ant1	97.29	0.12	0.44
NVNT	n40	5190	Ant1	94.79	0.23	0.9
NVNT	n40	5230	Ant1	94.71	0.24	0.9
NVNT	ac20	5180	Ant1	97.35	0.12	0.44
NVNT	ac20	5200	Ant1	97.34	0.12	0.44
NVNT	ac20	5240	Ant1	97.34	0.12	0.44
NVNT	ac40	5190	Ant1	94.72	0.24	0.9
NVNT	ac40	5230	Ant1	94.81	0.23	0.9
NVNT	ac80	5210	Ant1	89.65	0.47	1.86




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5180MHz Ant1

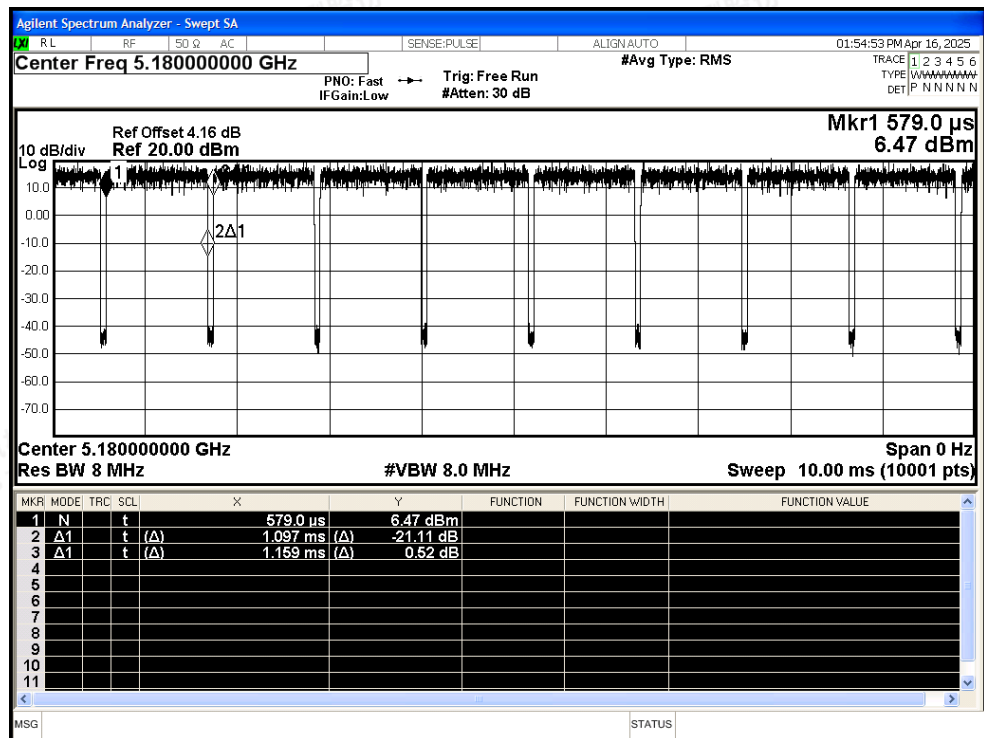


Duty Cycle NVNT a 5200MHz Ant1

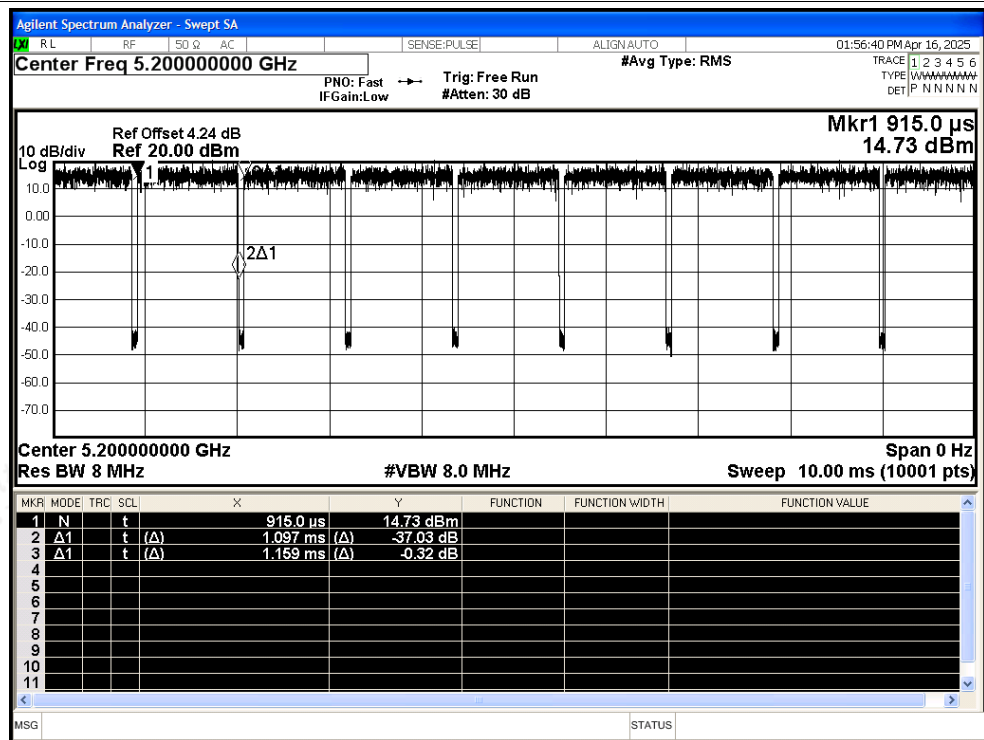




Duty Cycle NVNT a 5240MHz Ant1

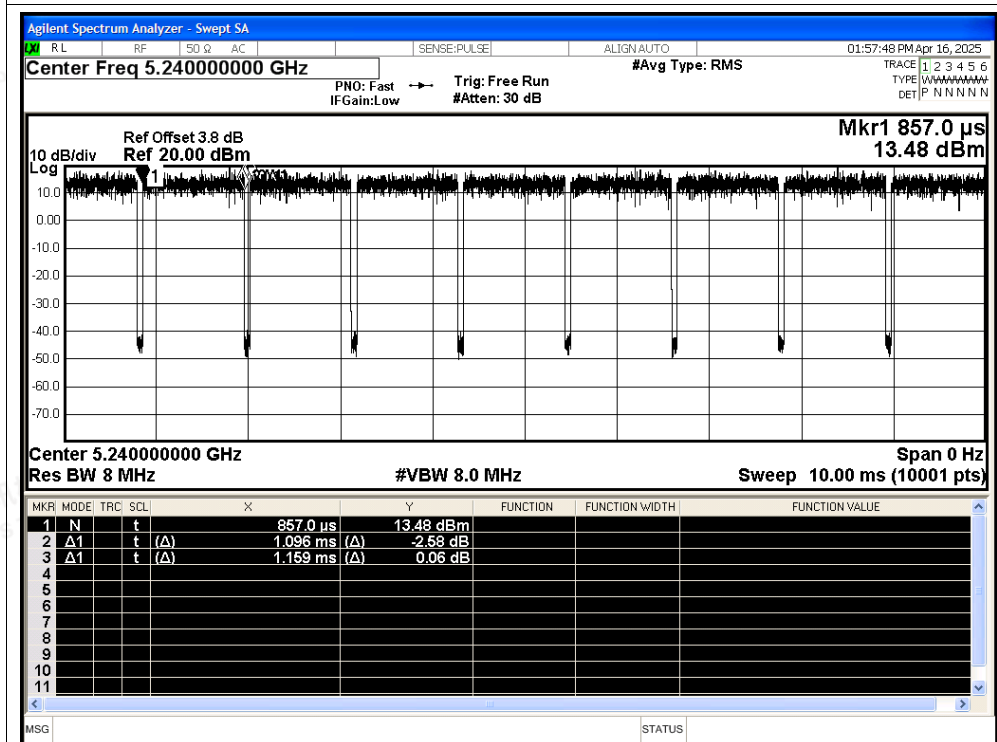


Duty Cycle NVNT n20 5180MHz Ant1

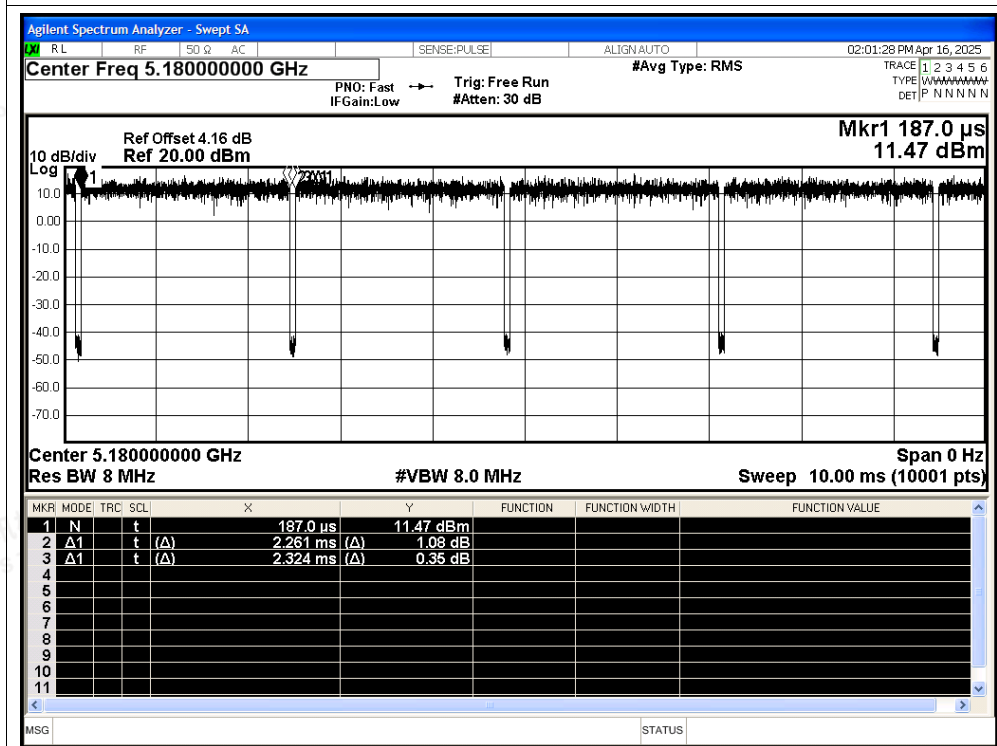




Duty Cycle NVNT n20 5200MHz Ant1

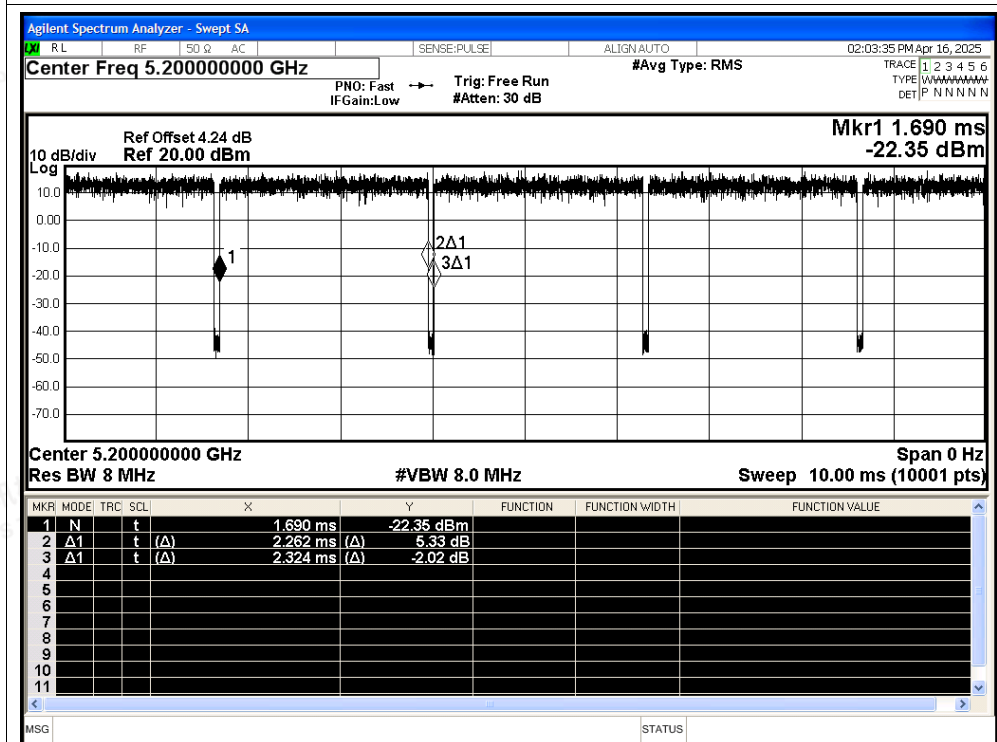


Duty Cycle NVNT n20 5240MHz Ant1

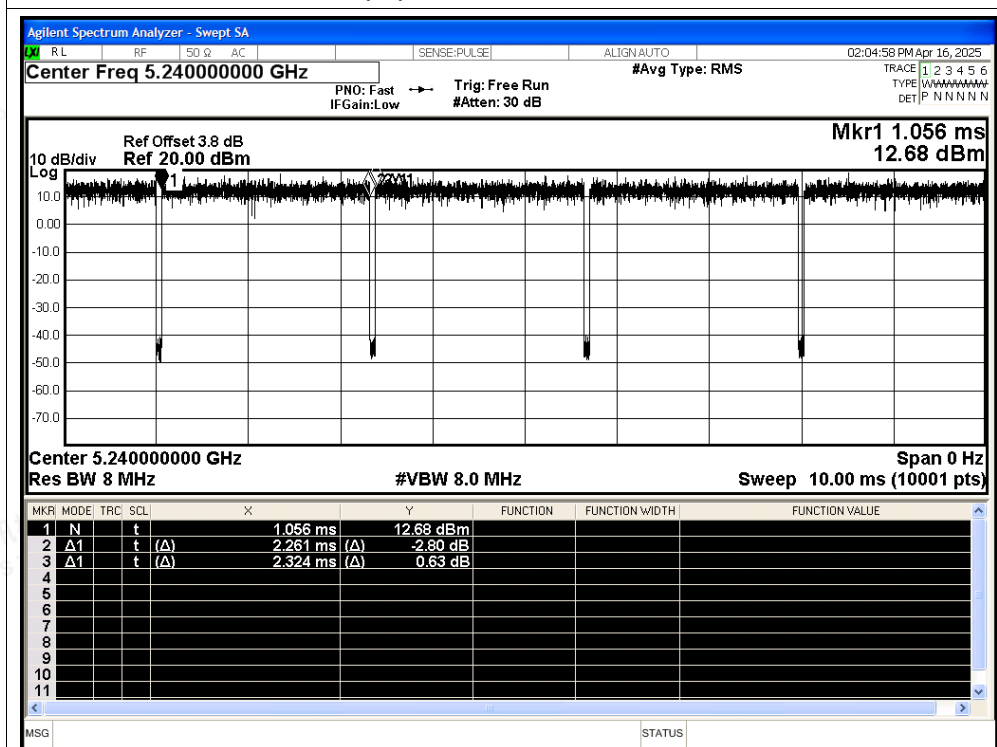




Duty Cycle NVNT n40 5190MHz Ant1

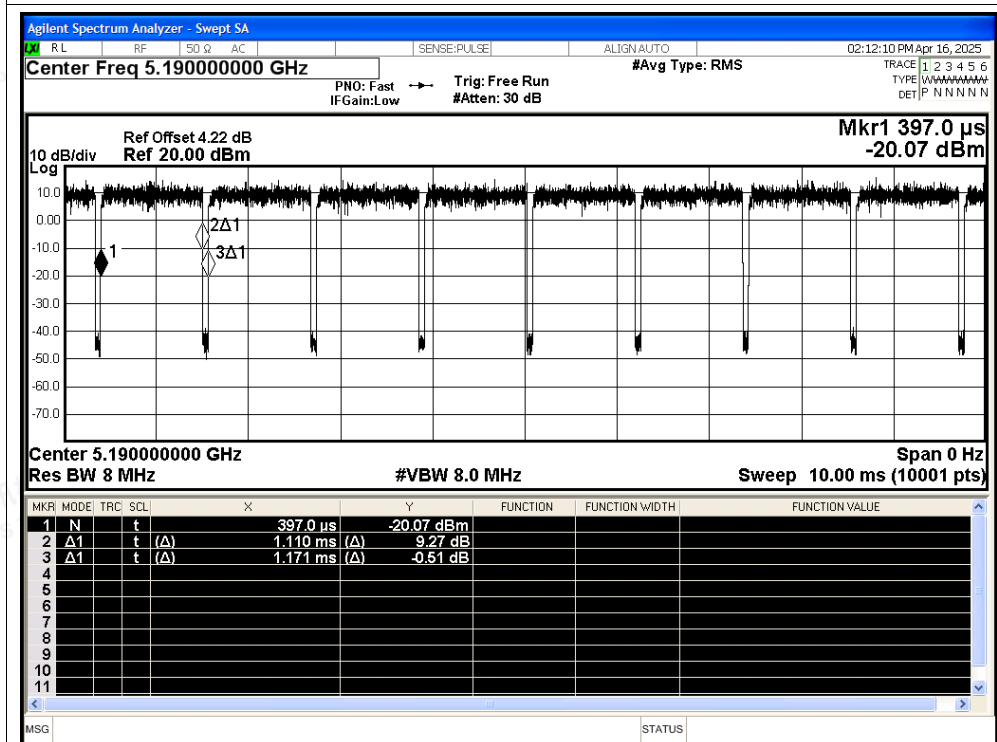


Duty Cycle NVNT n40 5230MHz Ant1

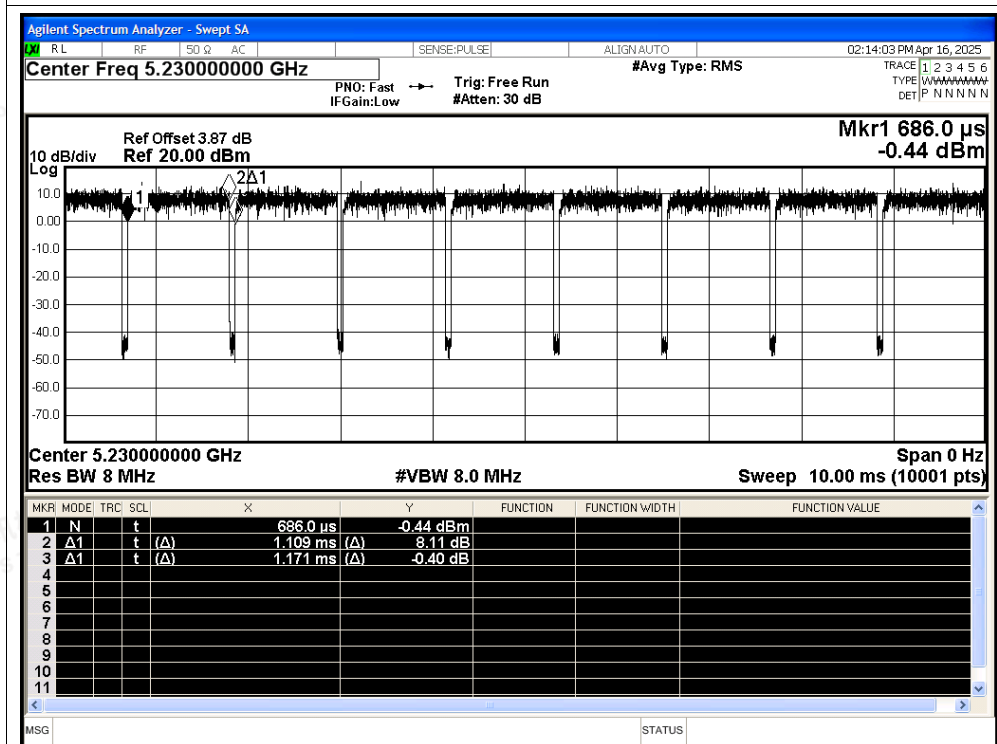




Duty Cycle NVNT ac20 5180MHz Ant1

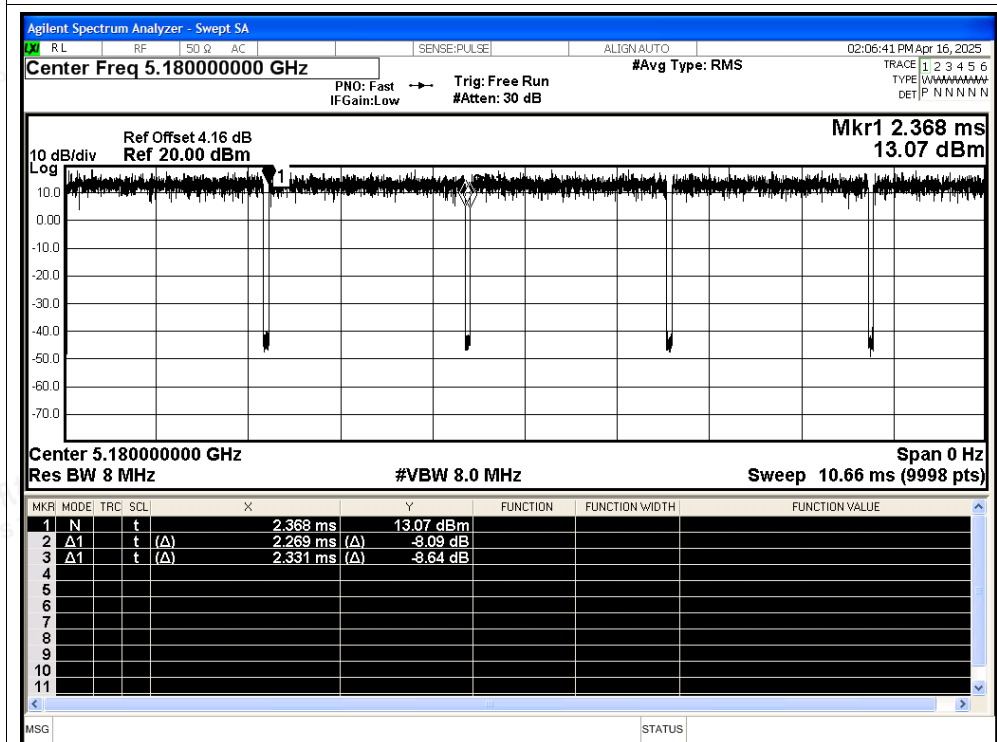


Duty Cycle NVNT ac20 5200MHz Ant1

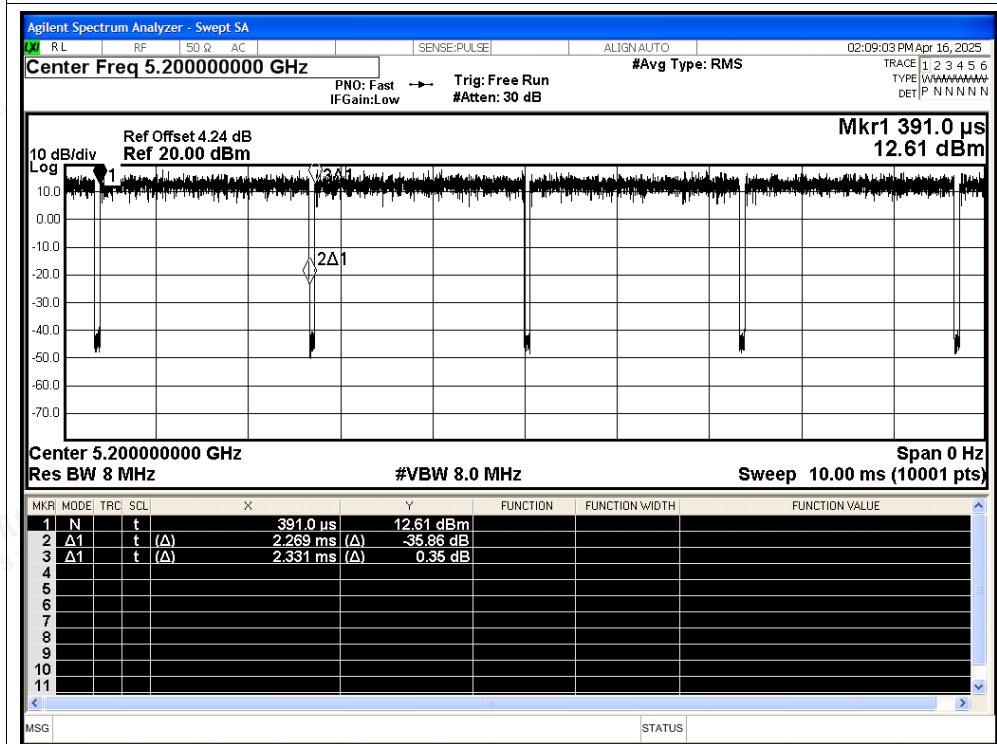




Duty Cycle NVNT ac20 5240MHz Ant1

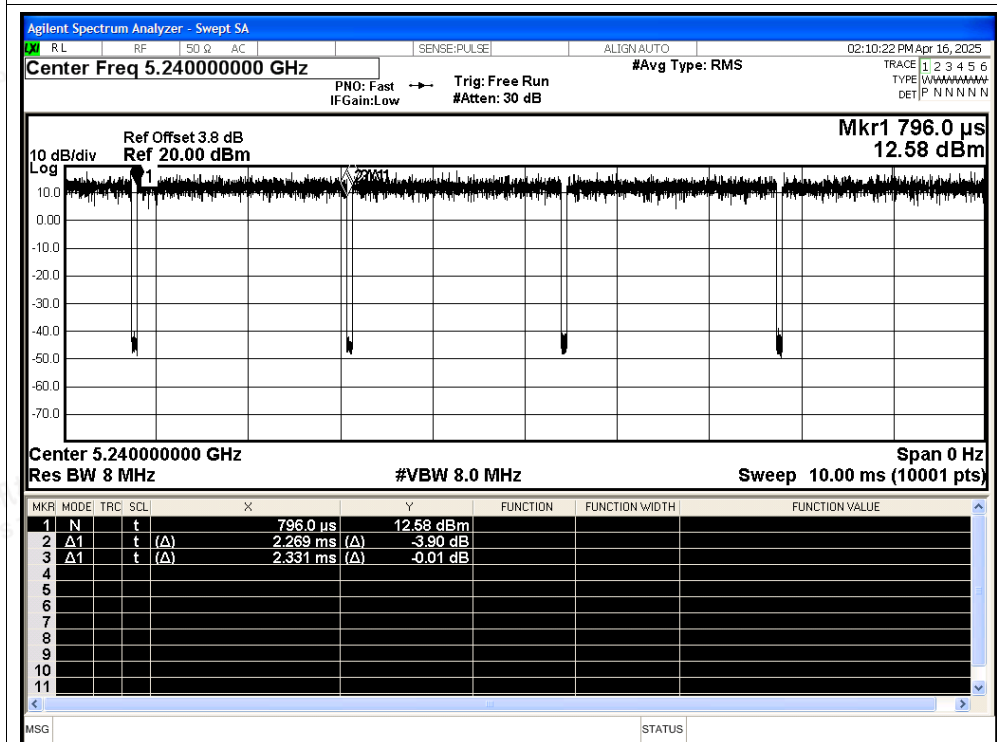


Duty Cycle NVNT ac40 5190MHz Ant1

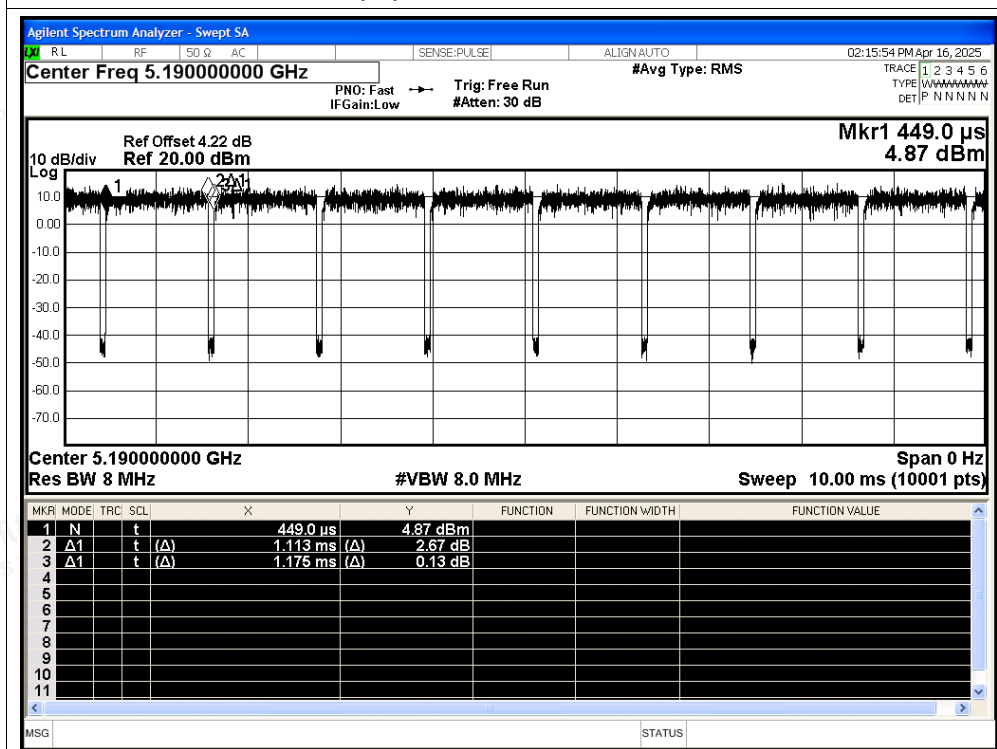




Duty Cycle NVNT ac40 5230MHz Ant1

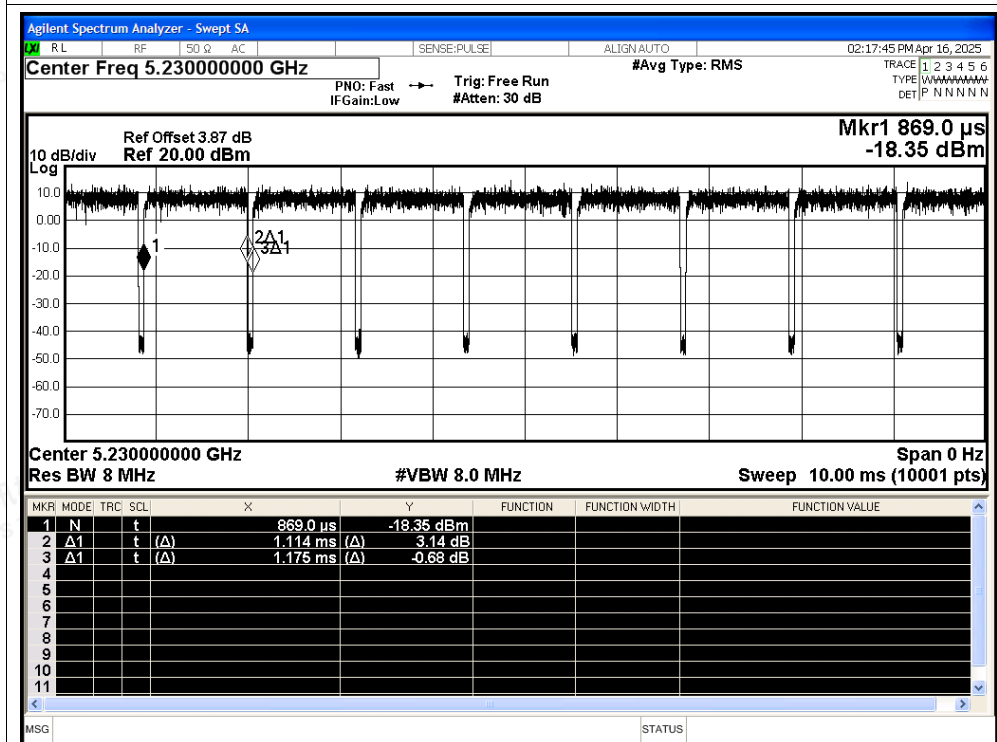

Duty Cycle NVNT ac80 5210MHz Ant1

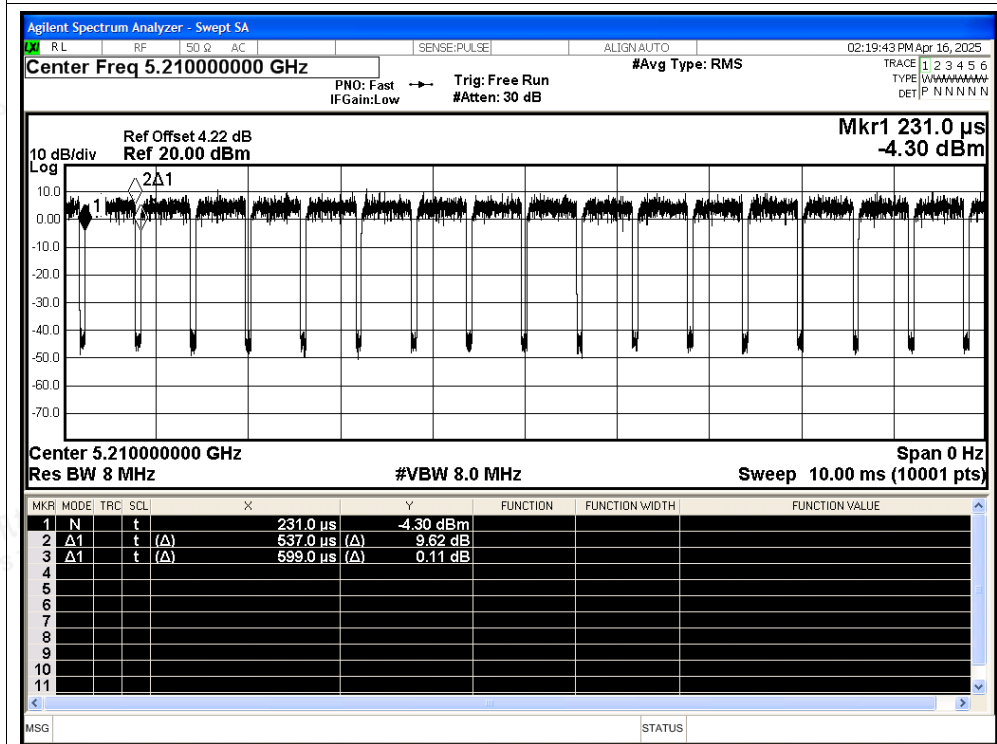



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant2	94.65	0.24	0.91
NVNT	a	5200	Ant2	94.65	0.24	0.91
NVNT	a	5240	Ant2	94.56	0.24	0.91
NVNT	n20	5180	Ant2	97.29	0.12	0.44
NVNT	n20	5200	Ant2	97.29	0.12	0.44
NVNT	n20	5240	Ant2	97.29	0.12	0.44
NVNT	n40	5190	Ant2	94.71	0.24	0.9
NVNT	n40	5230	Ant2	94.71	0.24	0.9
NVNT	ac20	5180	Ant2	97.35	0.12	0.44
NVNT	ac20	5200	Ant2	97.34	0.12	0.44
NVNT	ac20	5240	Ant2	97.34	0.12	0.44
NVNT	ac40	5190	Ant2	94.72	0.24	0.9
NVNT	ac40	5230	Ant2	94.72	0.24	0.9
NVNT	ac80	5210	Ant2	89.65	0.47	1.86




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5180MHz Ant2

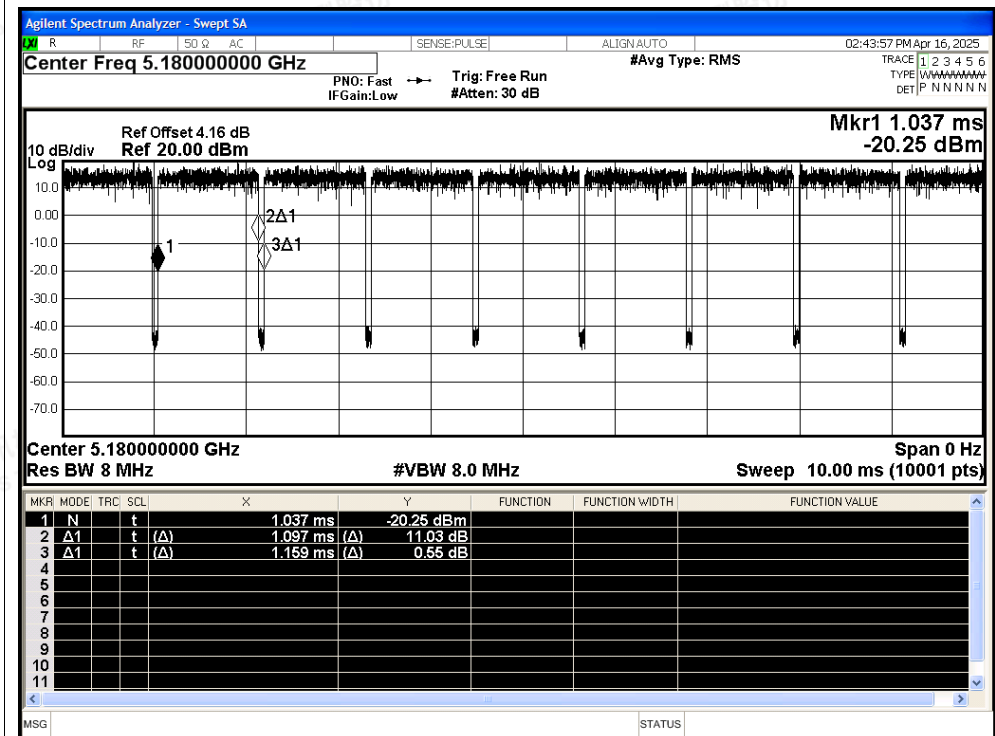


Duty Cycle NVNT a 5200MHz Ant2

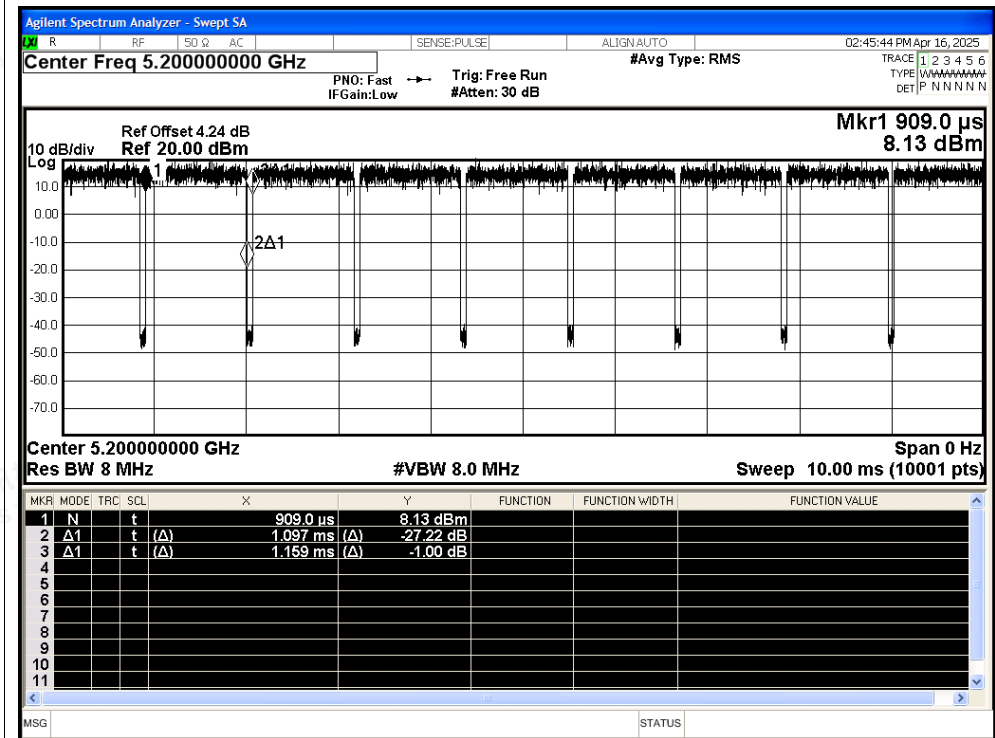






Duty Cycle NVNT a 5240MHz Ant2

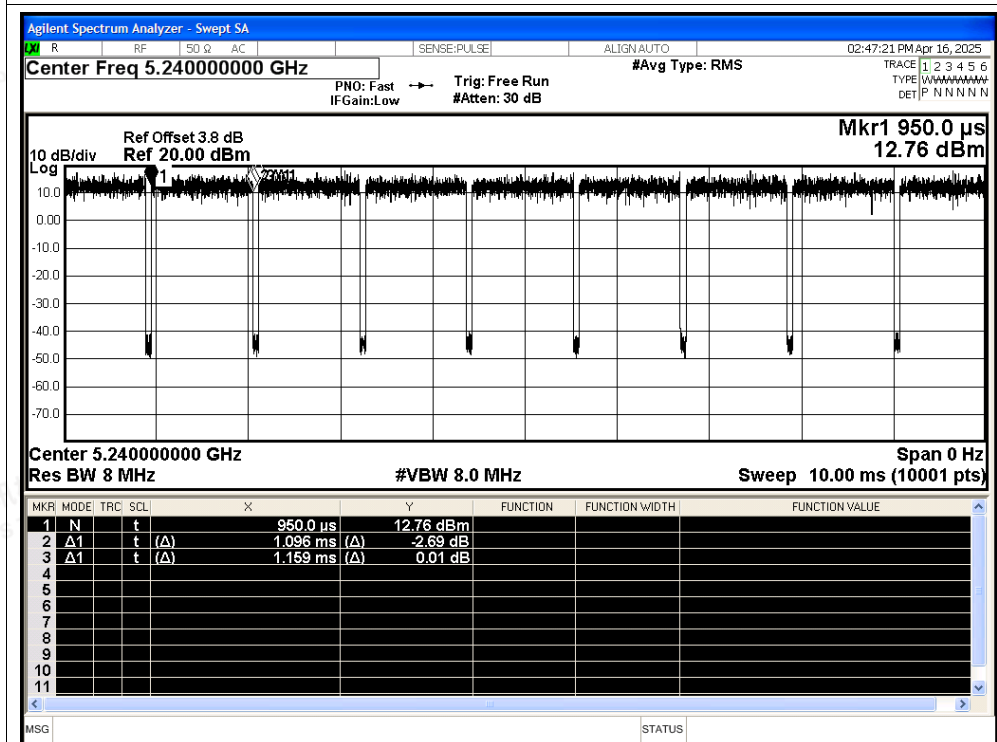


Duty Cycle NVNT n20 5180MHz Ant2

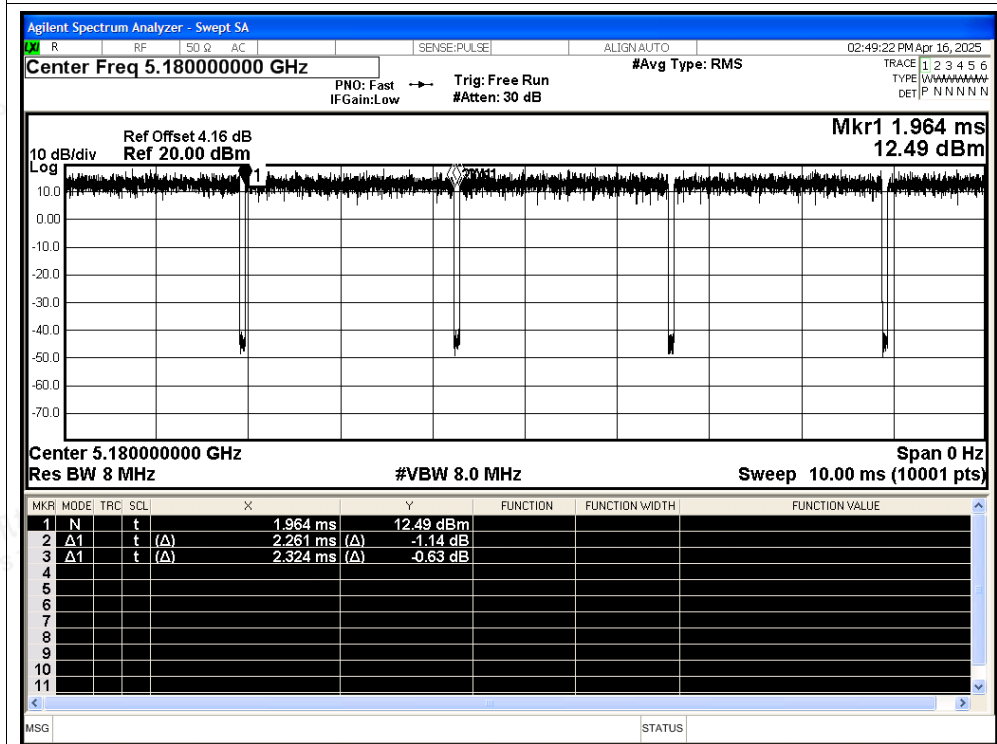

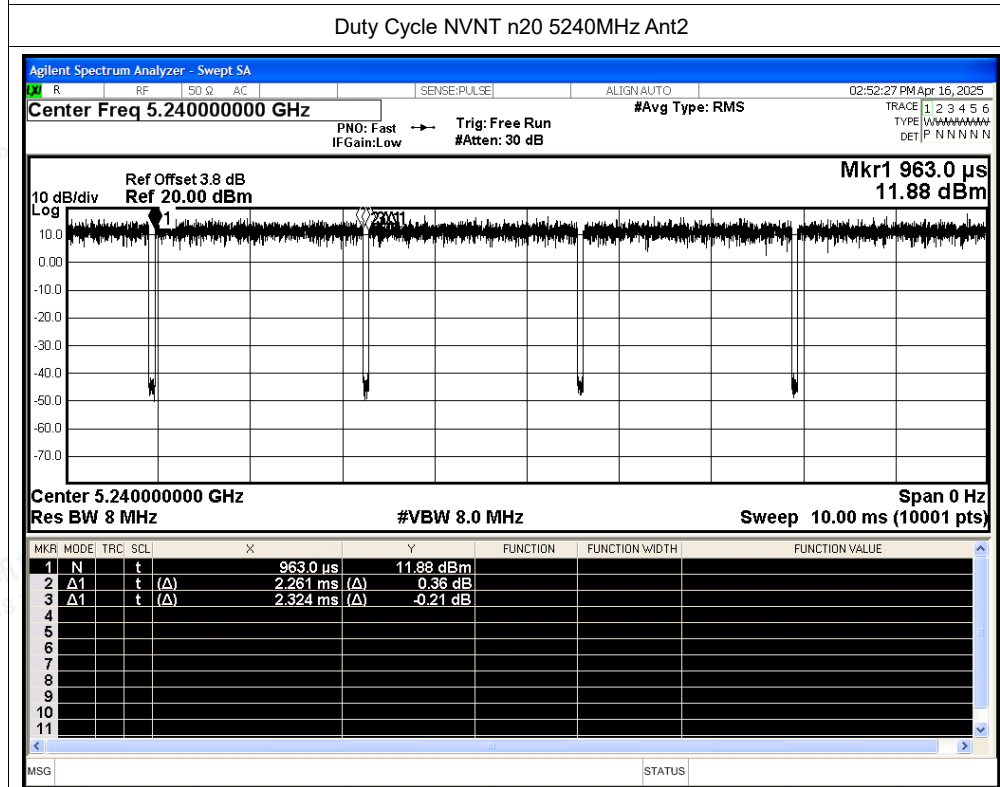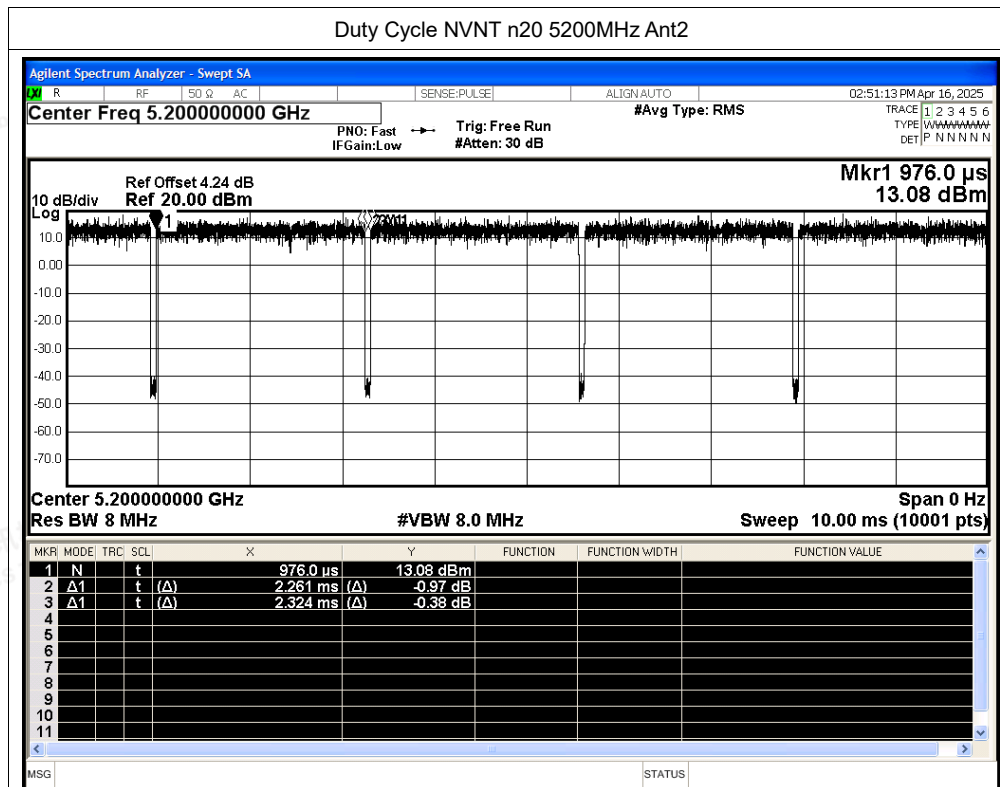






Duty Cycle NVNT n40 5190MHz Ant2

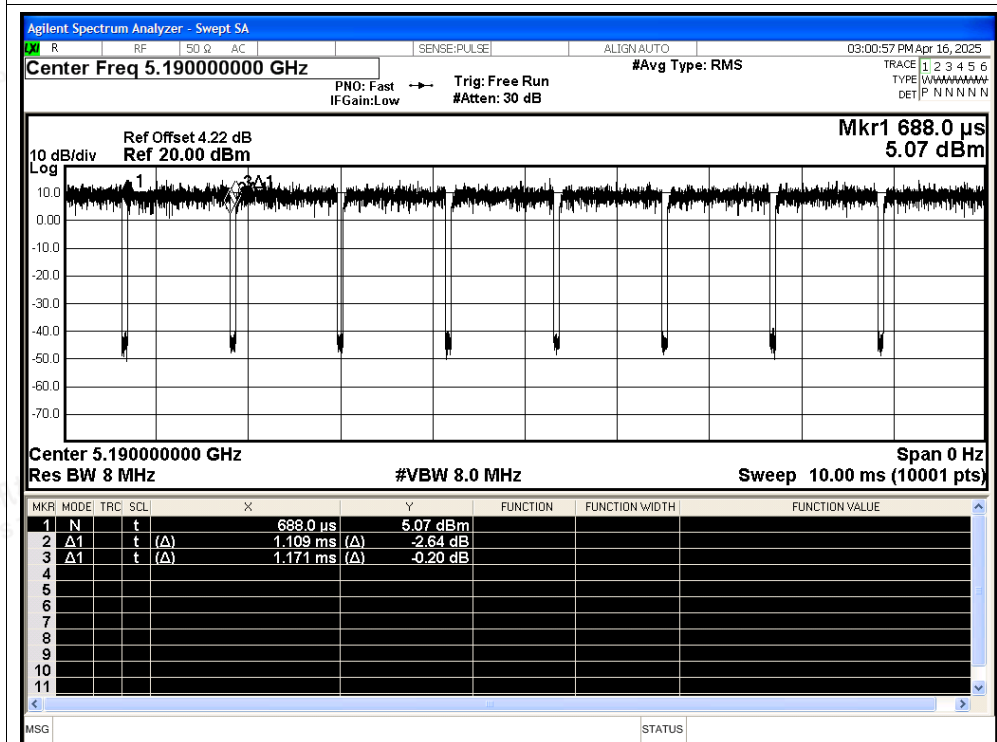


Duty Cycle NVNT n40 5230MHz Ant2

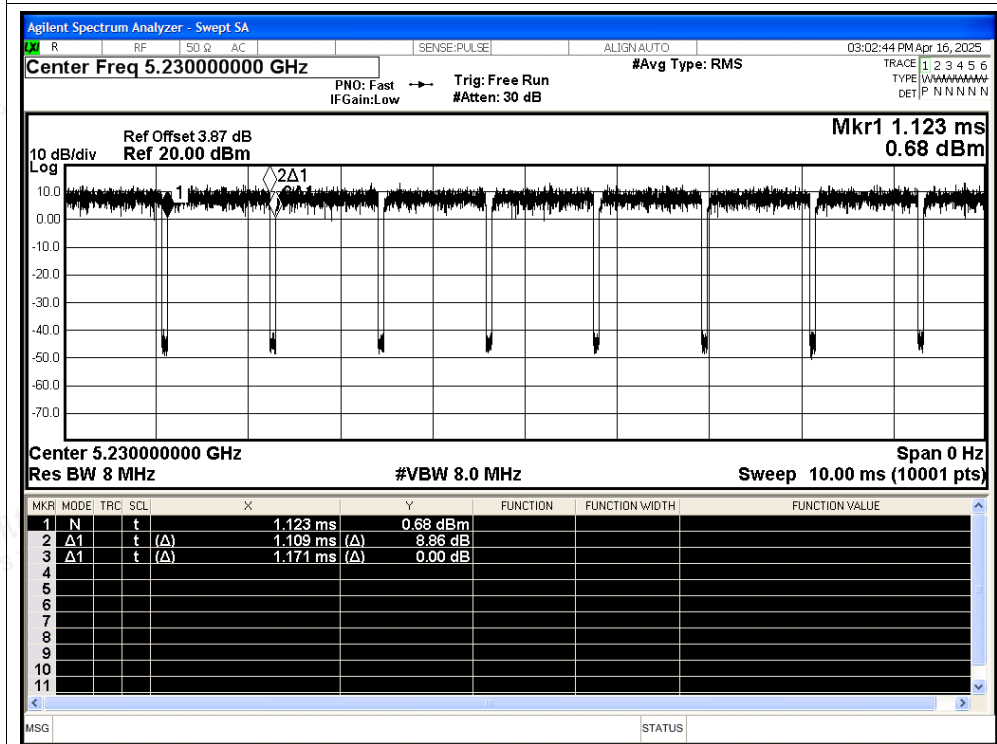

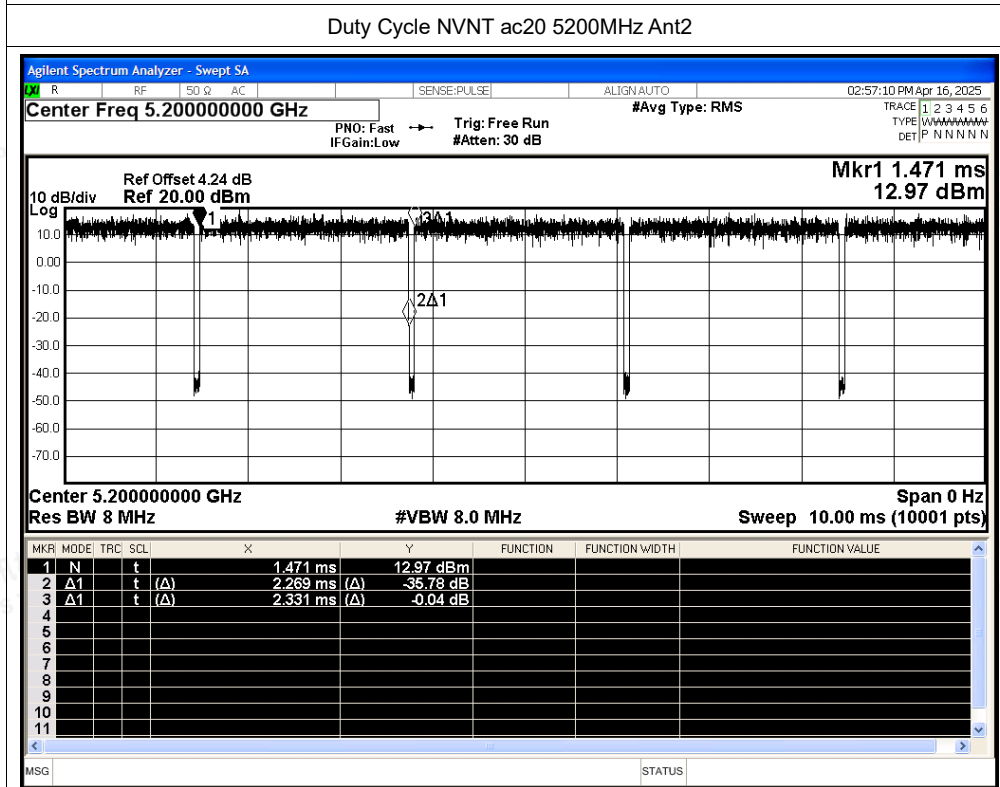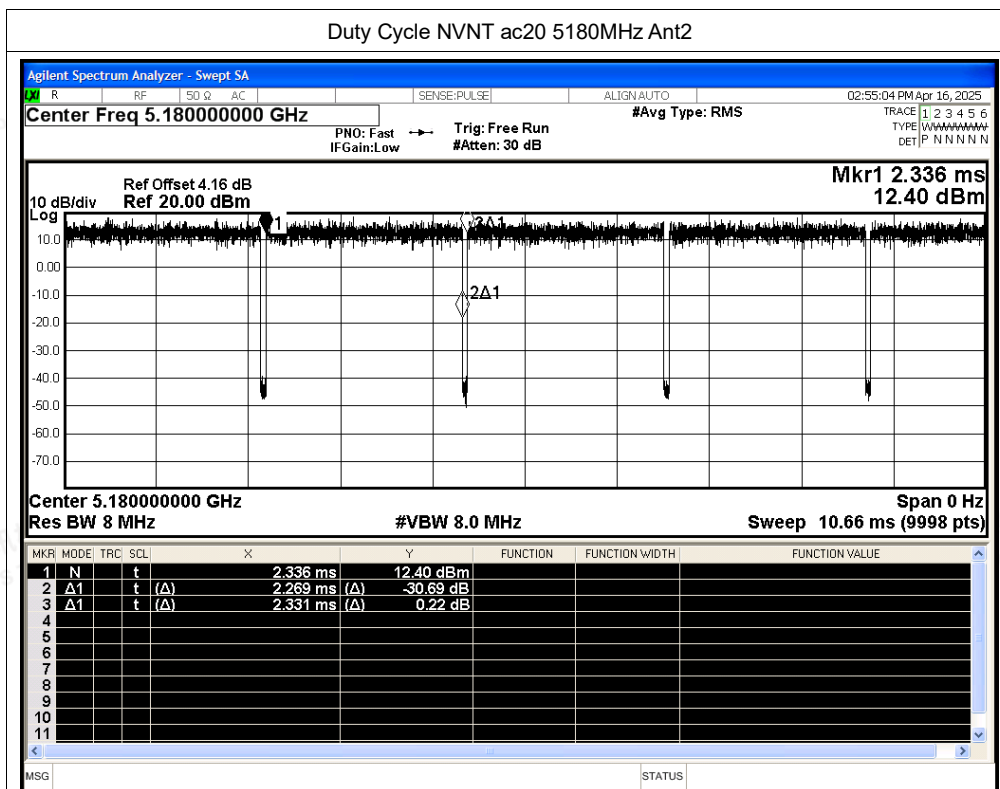




Duty Cycle NVNT ac20 5240MHz Ant2

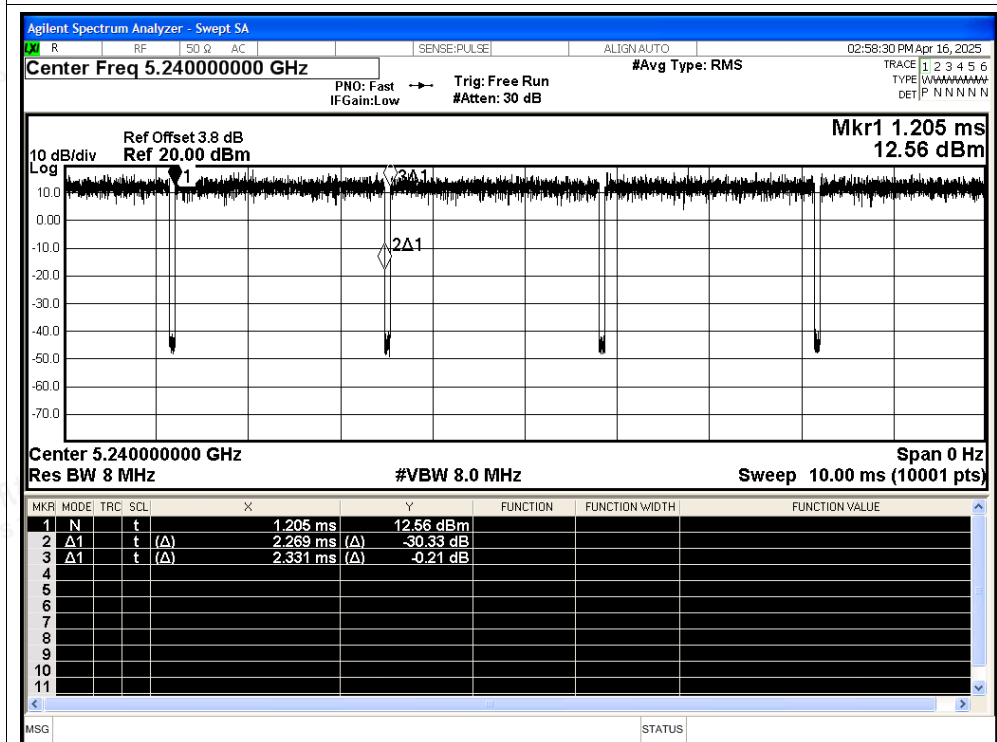


Duty Cycle NVNT ac40 5190MHz Ant2

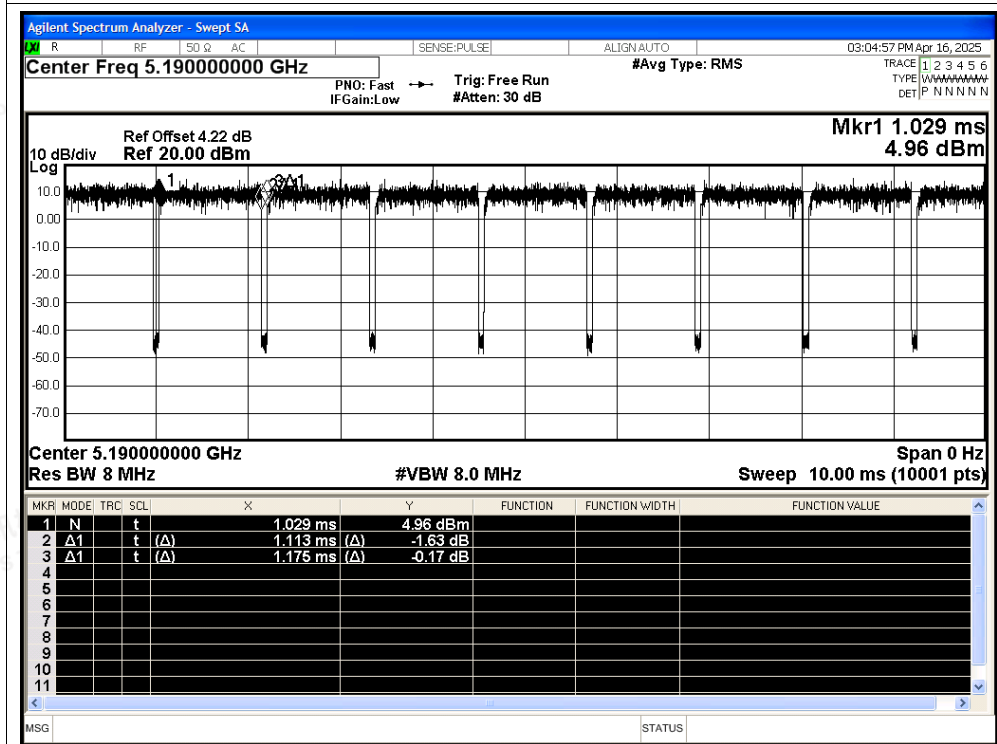




Duty Cycle NVNT ac40 5230MHz Ant2

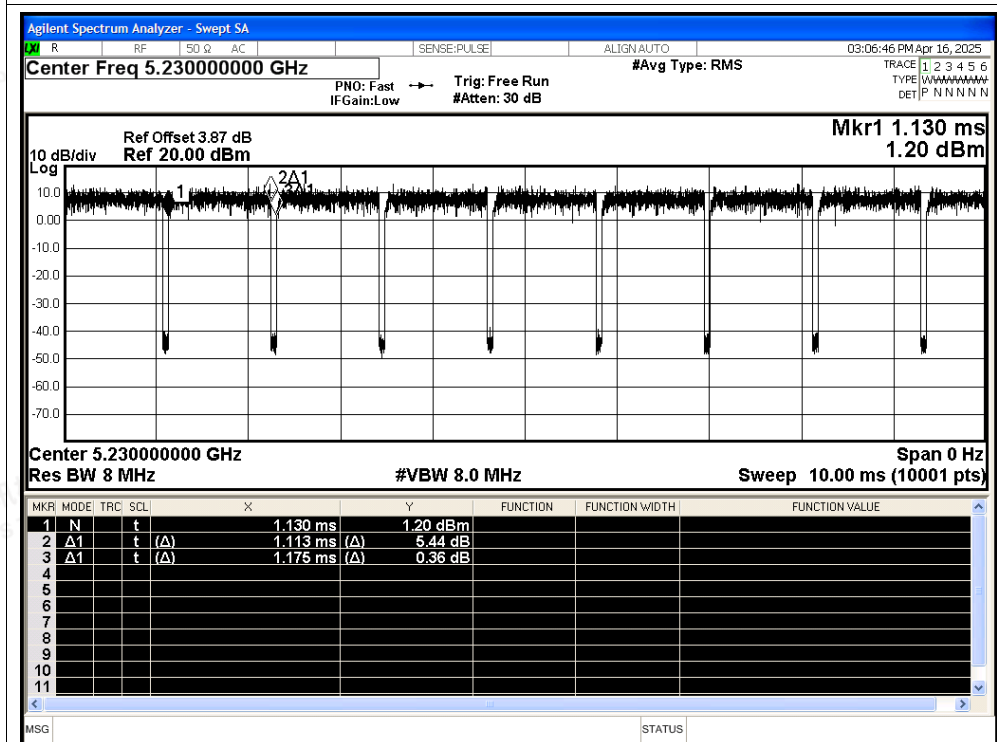

Duty Cycle NVNT ac80 5210MHz Ant2

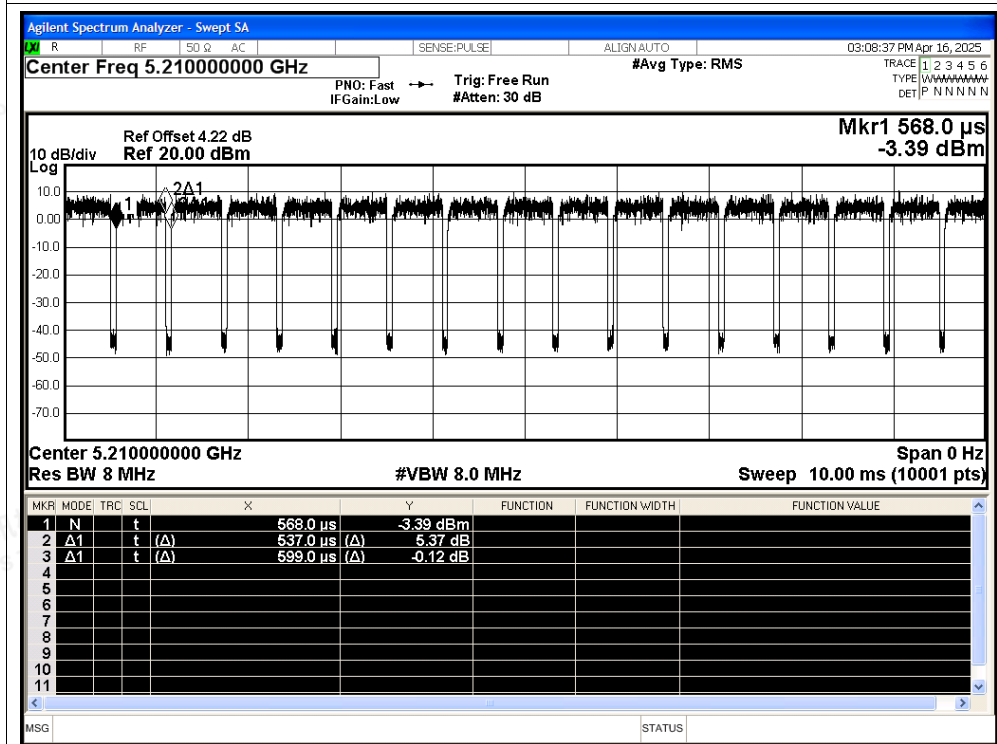



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant3	94.56	0.24	0.91
NVNT	a	5200	Ant3	94.65	0.24	0.91
NVNT	a	5240	Ant3	94.56	0.24	0.91
NVNT	n20	5180	Ant3	97.33	0.12	0.44
NVNT	n20	5200	Ant3	97.29	0.12	0.44
NVNT	n20	5240	Ant3	97.29	0.12	0.44
NVNT	n40	5190	Ant3	94.71	0.24	0.9
NVNT	n40	5230	Ant3	94.71	0.24	0.9
NVNT	ac20	5180	Ant3	97.35	0.12	0.44
NVNT	ac20	5200	Ant3	97.34	0.12	0.44
NVNT	ac20	5240	Ant3	97.34	0.12	0.44
NVNT	ac40	5190	Ant3	94.72	0.24	0.9
NVNT	ac40	5230	Ant3	94.72	0.24	0.9
NVNT	ac80	5210	Ant3	89.65	0.47	1.86




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5180MHz Ant3

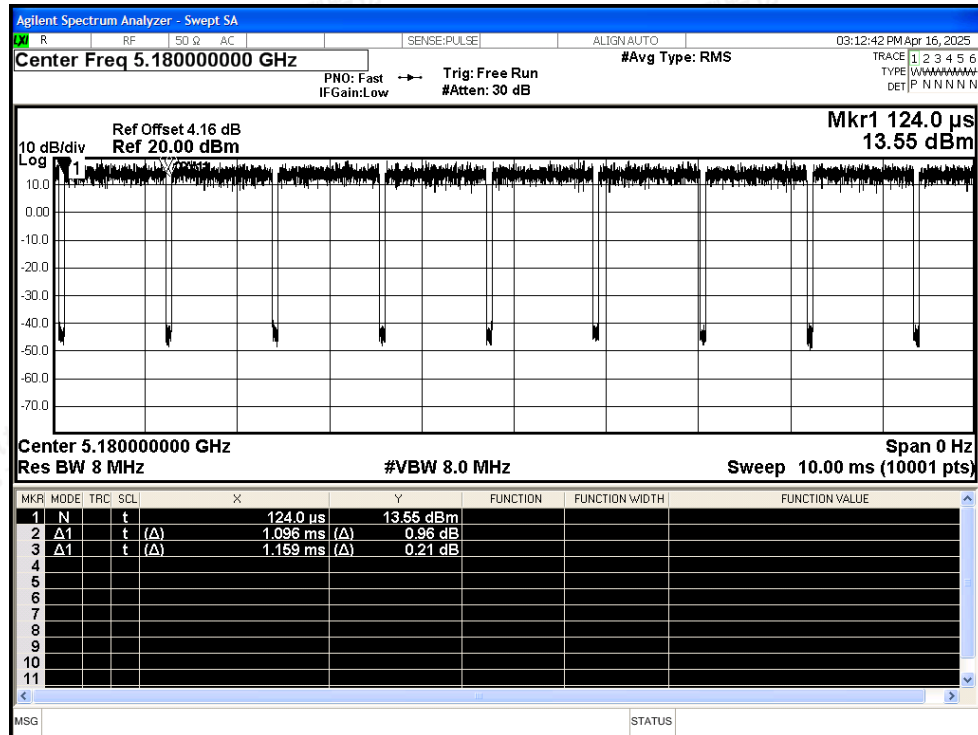


Duty Cycle NVNT a 5200MHz Ant3

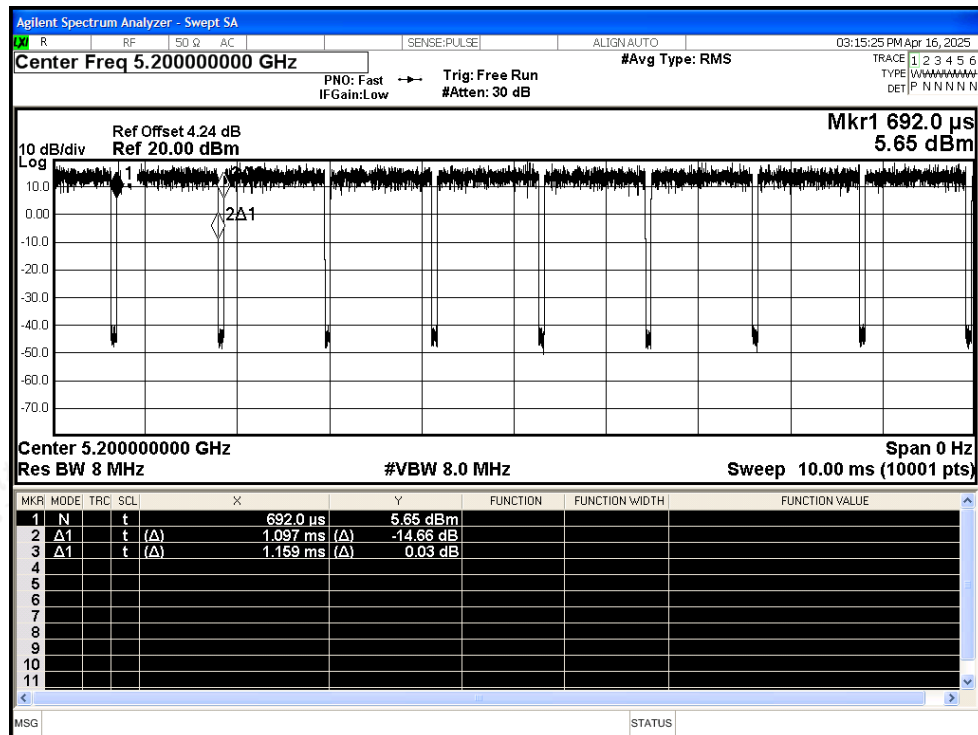




Duty Cycle NVNT a 5240MHz Ant3

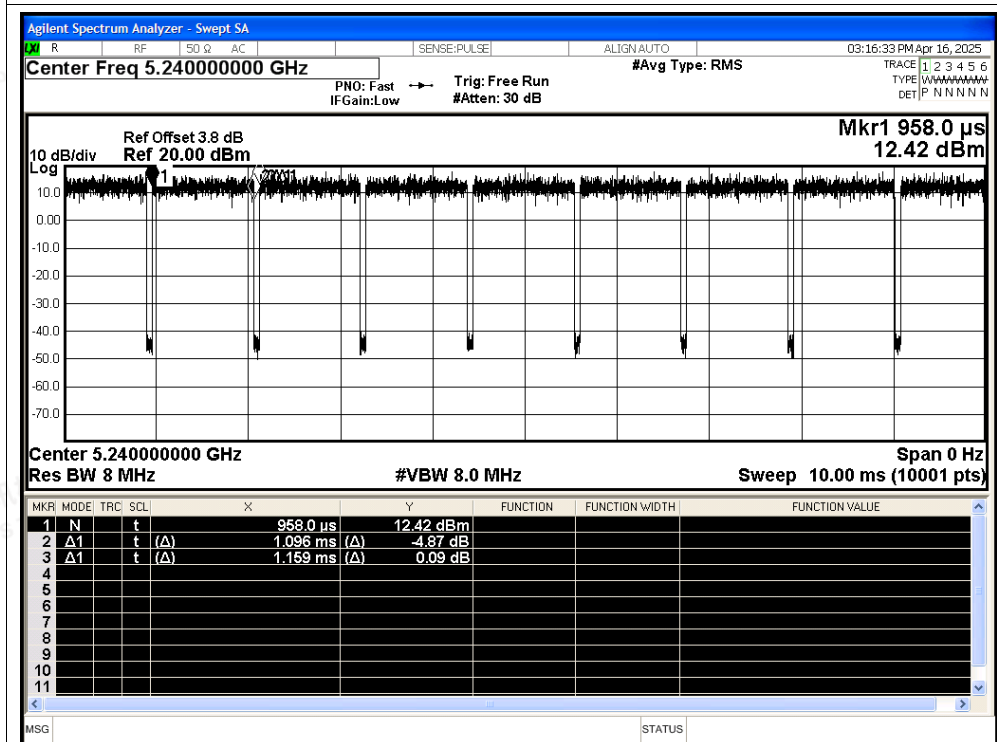


Duty Cycle NVNT n20 5180MHz Ant3

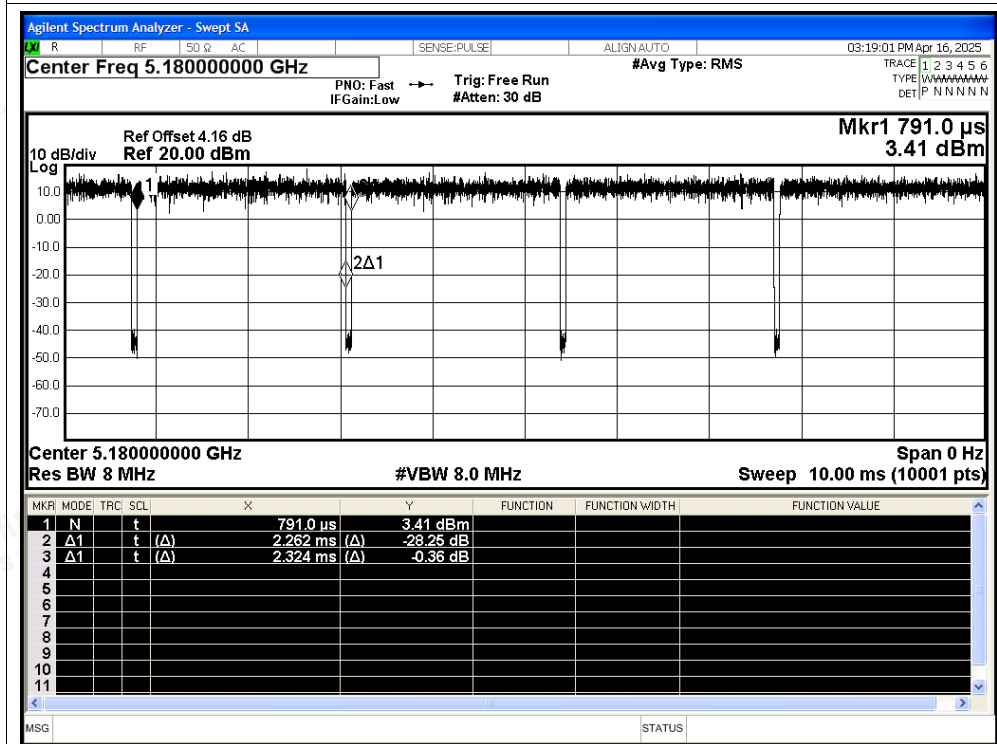




Duty Cycle NVNT n20 5200MHz Ant3

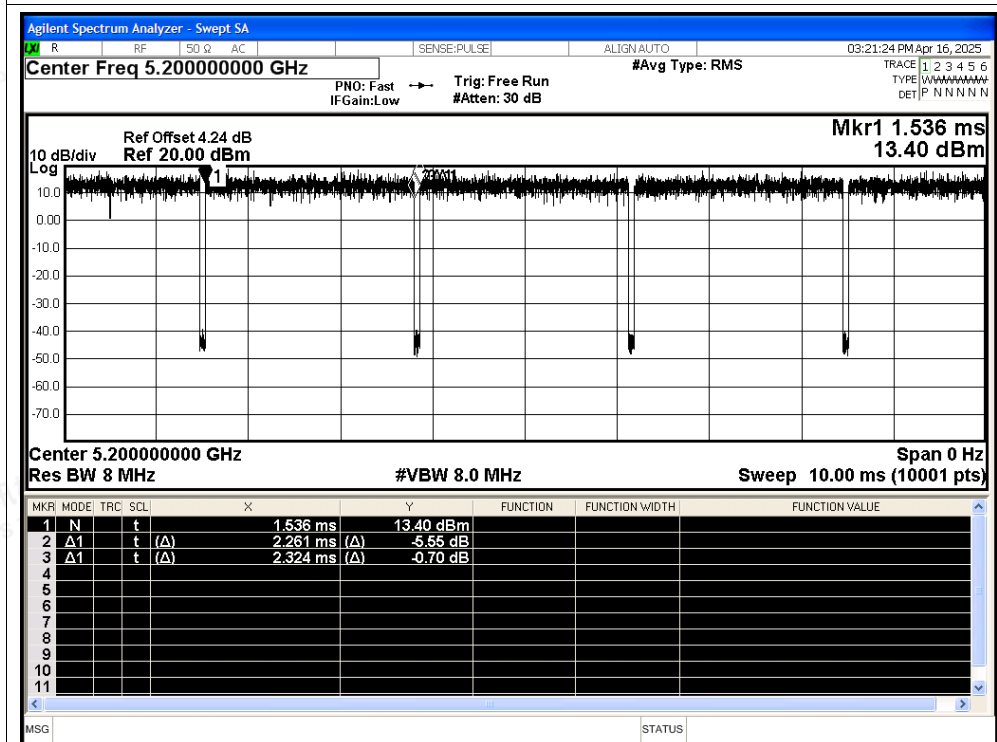


Duty Cycle NVNT n20 5240MHz Ant3

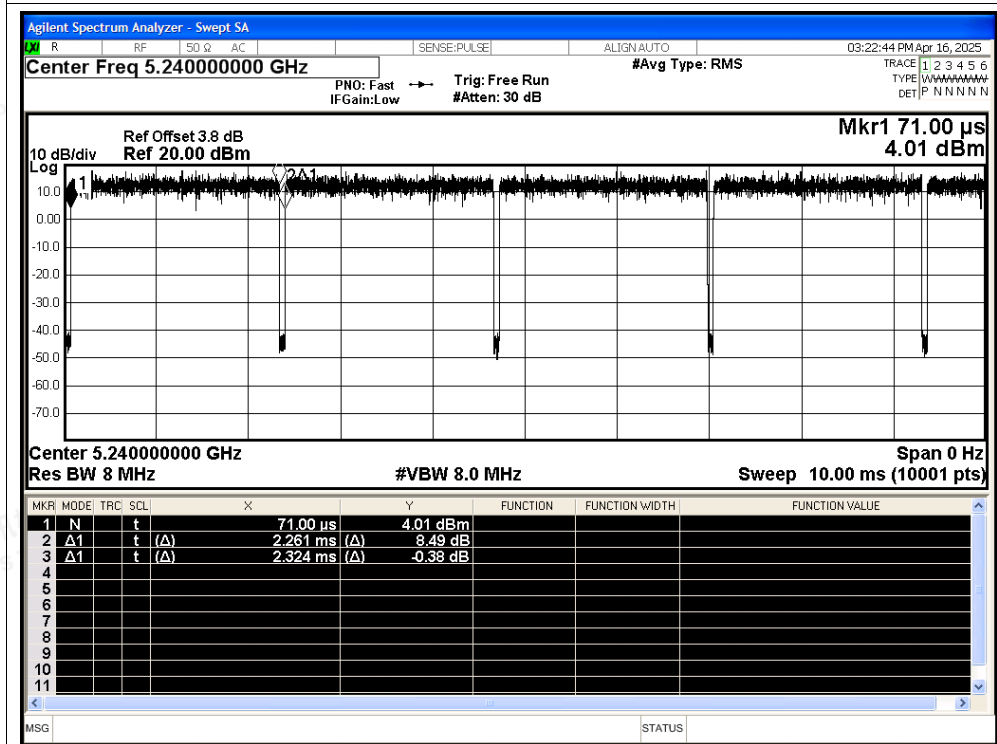






Duty Cycle NVNT n40 5190MHz Ant3

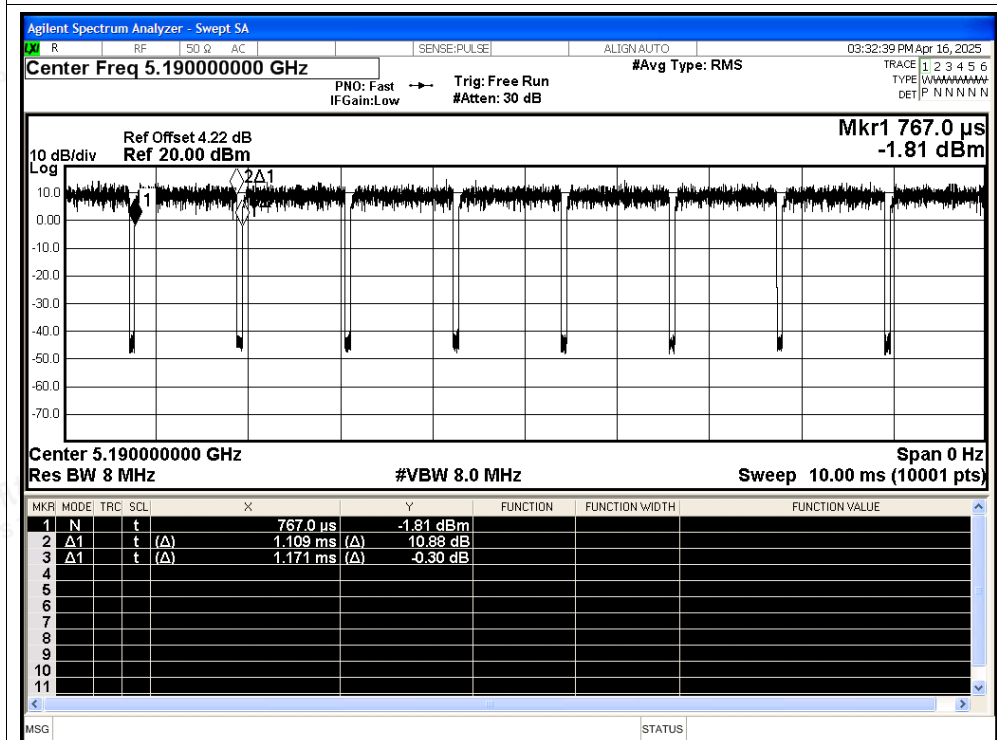


Duty Cycle NVNT n40 5230MHz Ant3

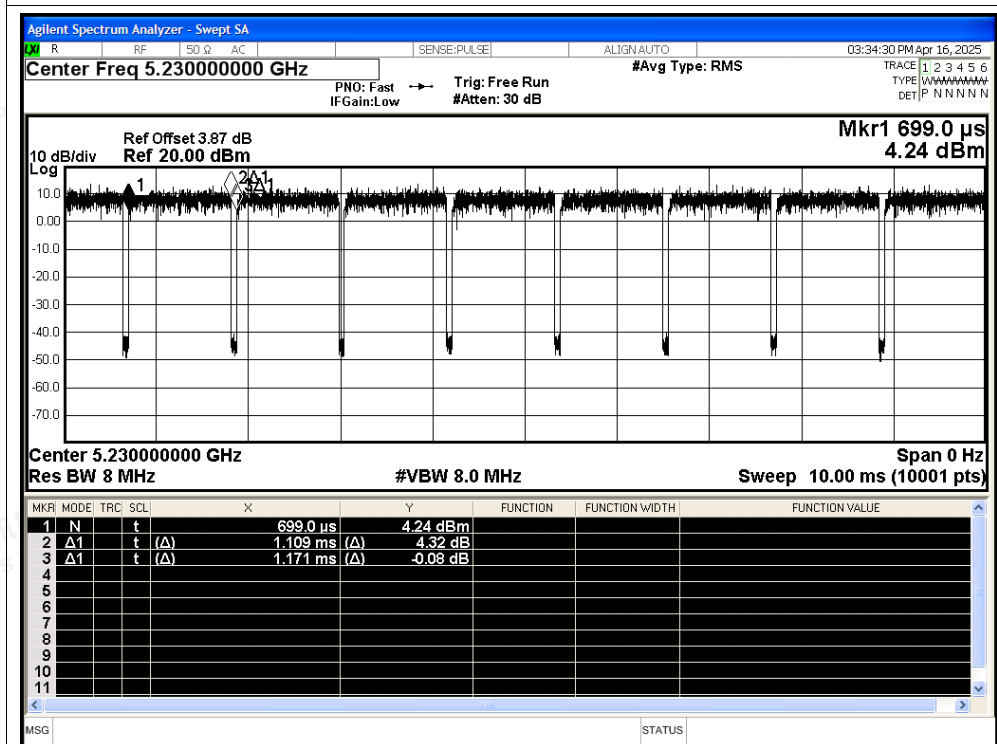

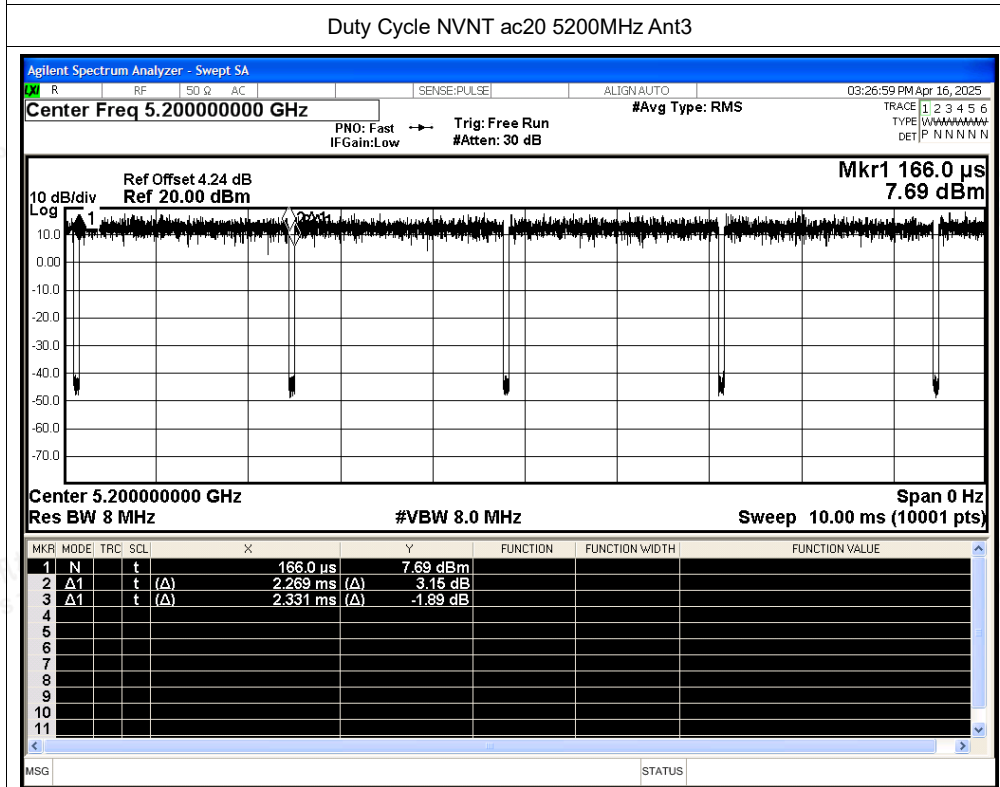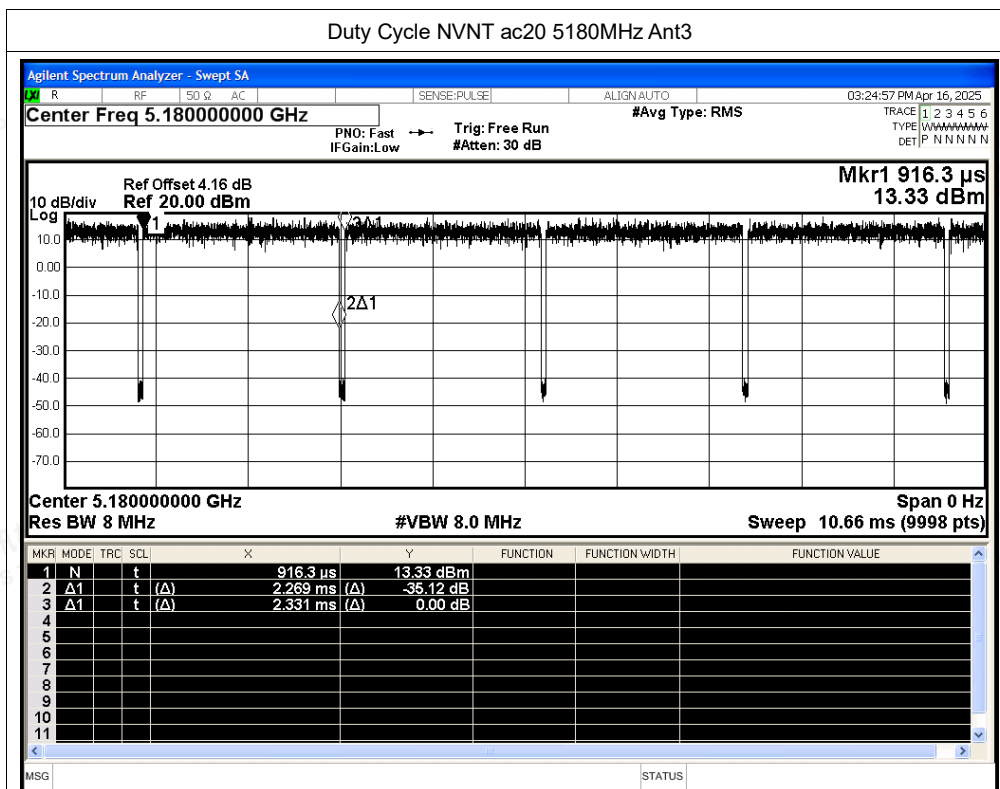




Duty Cycle NVNT ac20 5240MHz Ant3

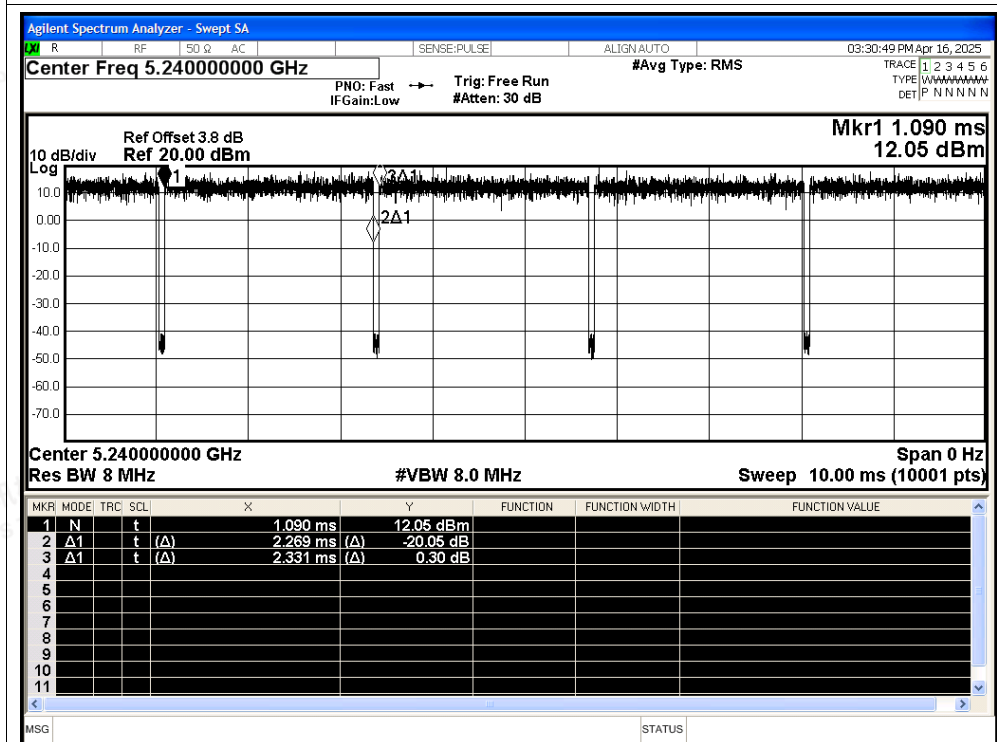


Duty Cycle NVNT ac40 5190MHz Ant3

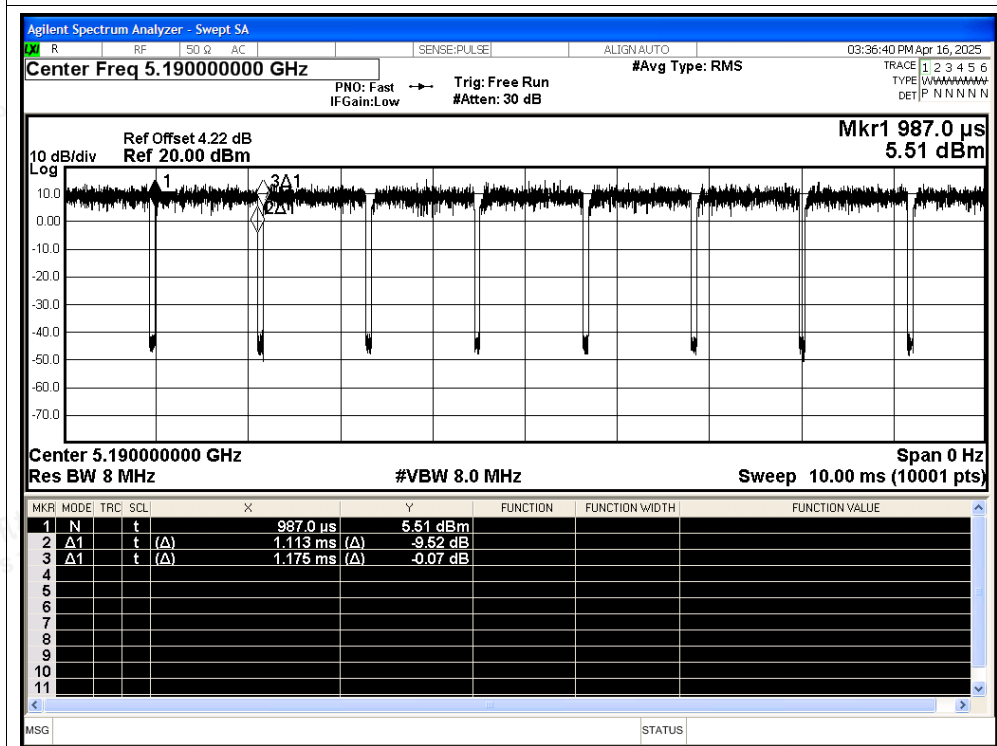



Duty Cycle NVNT ac40 5230MHz Ant3

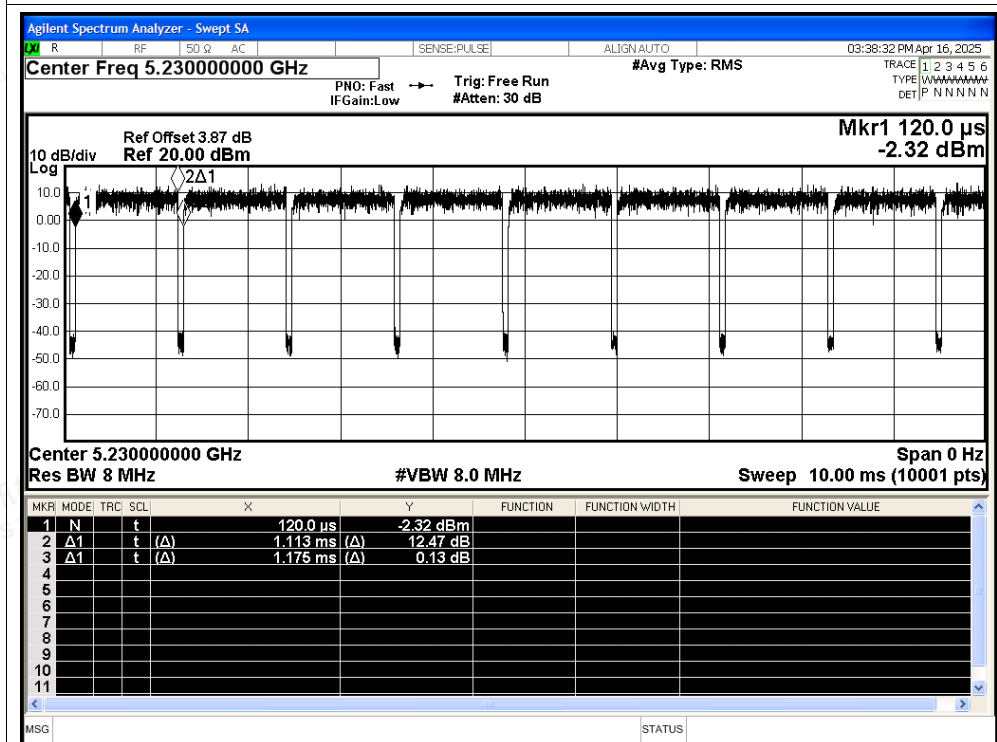

Duty Cycle NVNT ac80 5210MHz Ant3

