




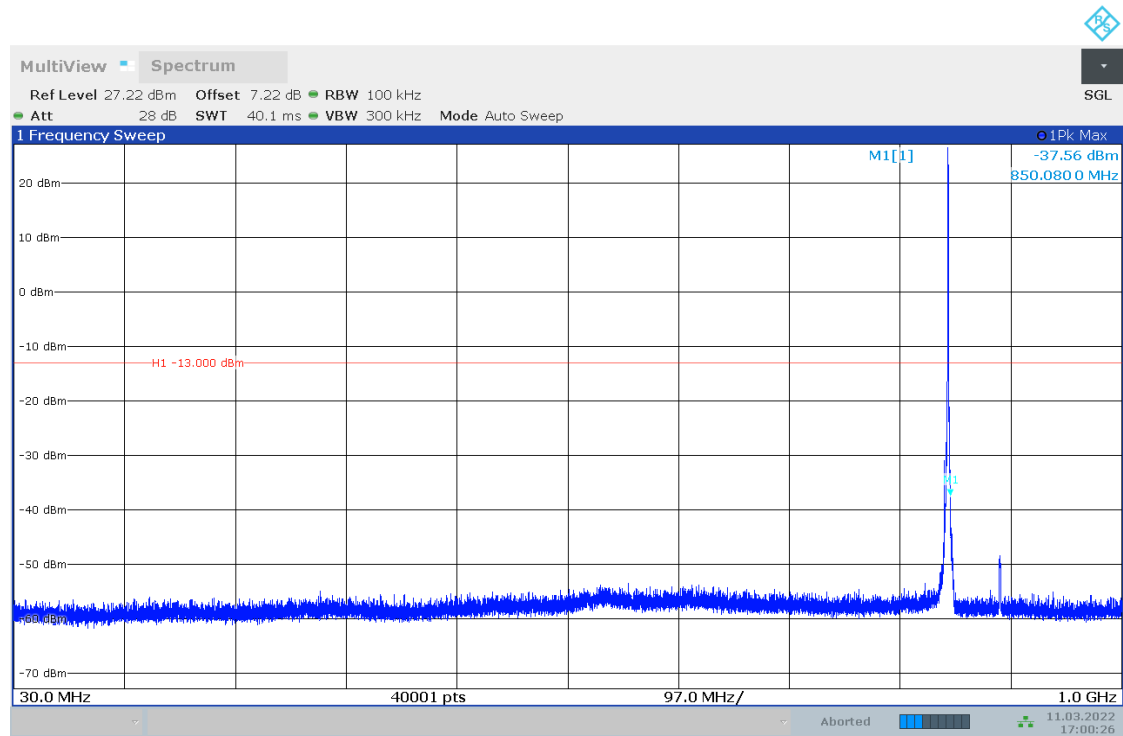



17:00:26 11.03.2022

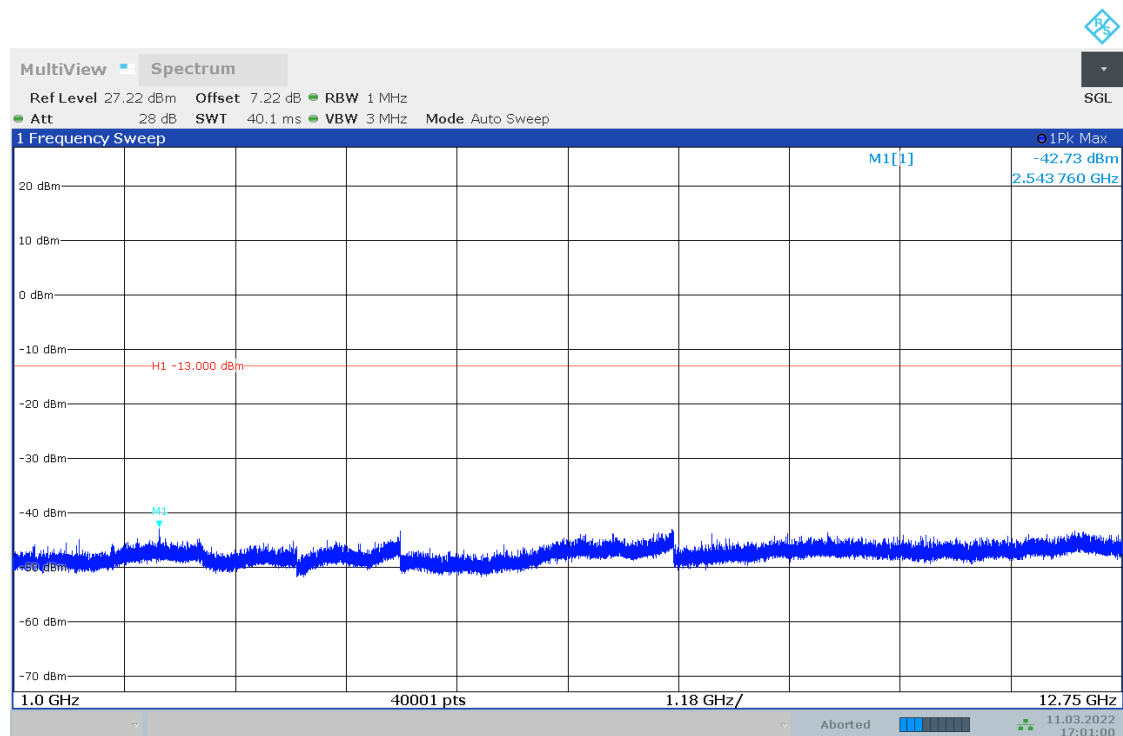


17:01:00 11.03.2022

6.2.35 TM2_1.4MHz_HCH_RB1#5

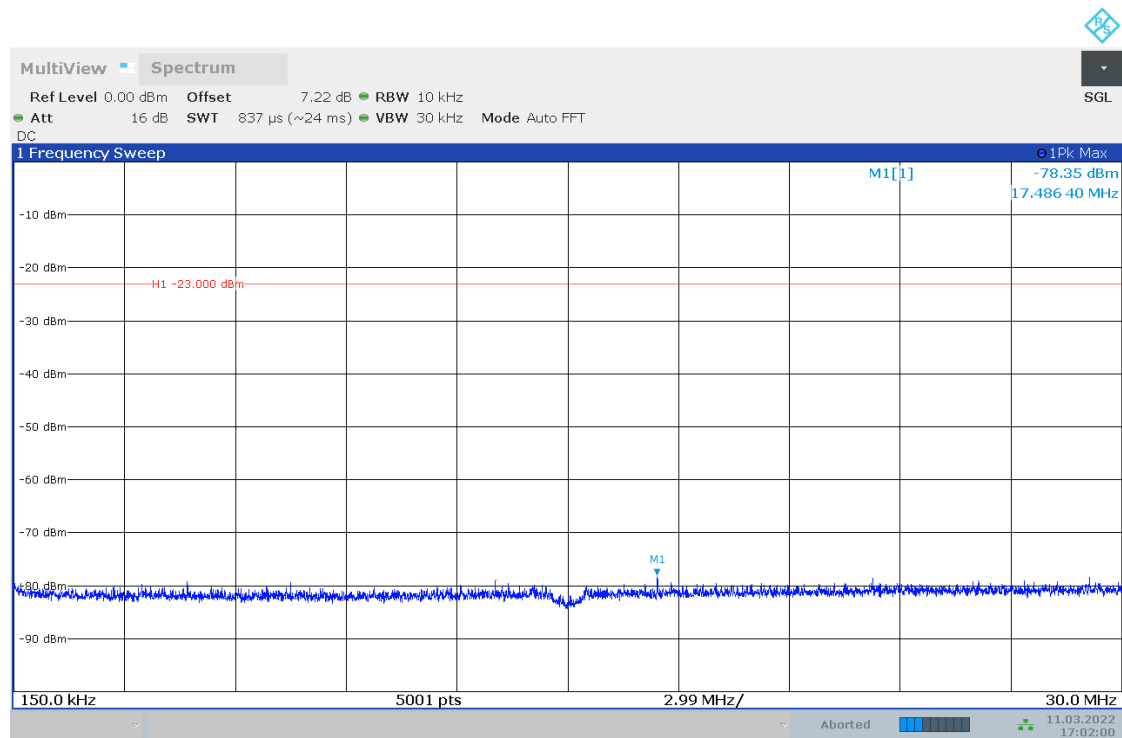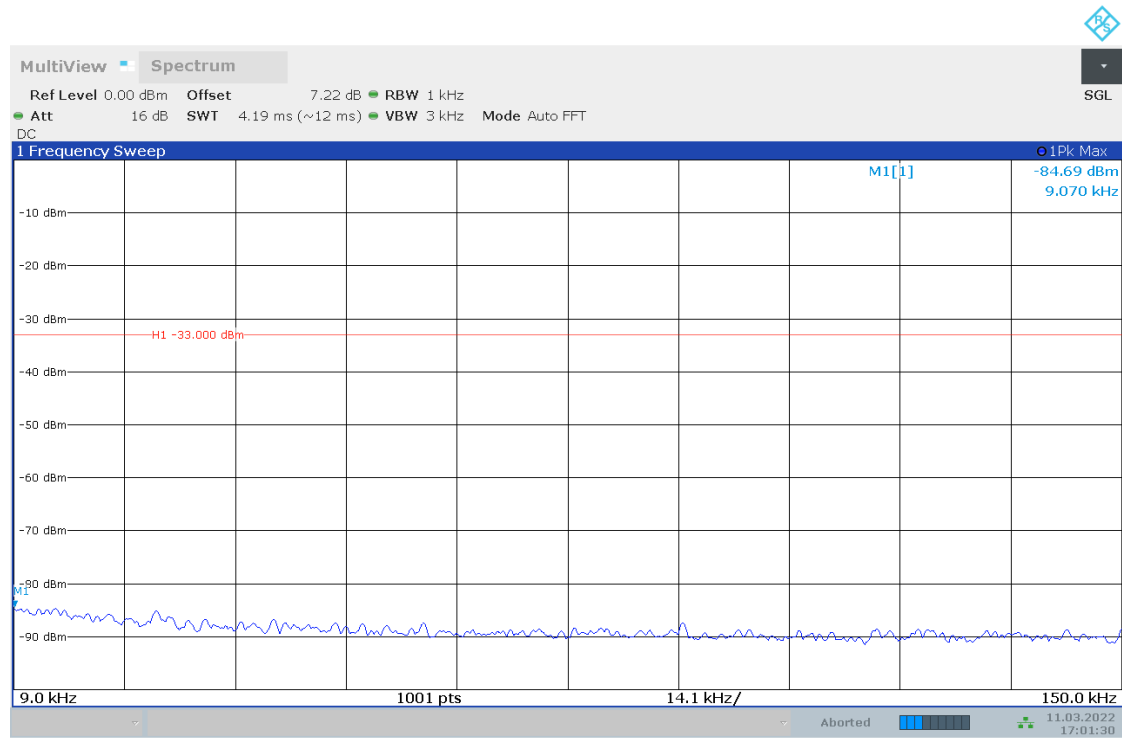


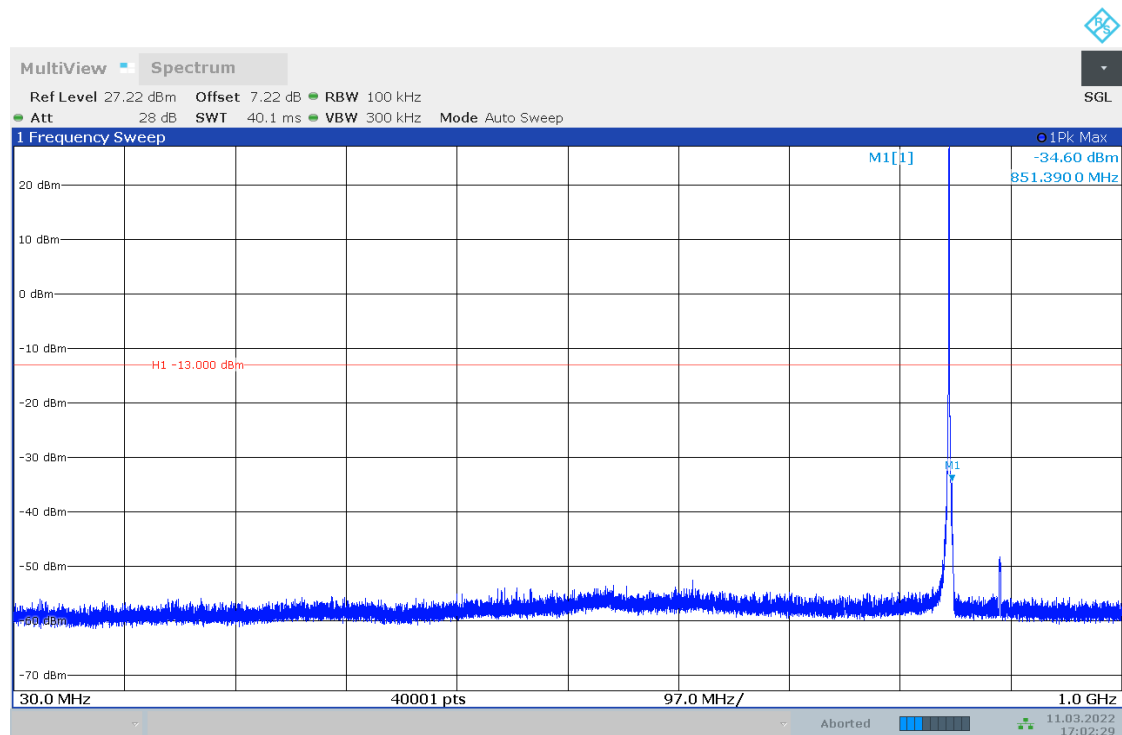



17:02:29 11.03.2022

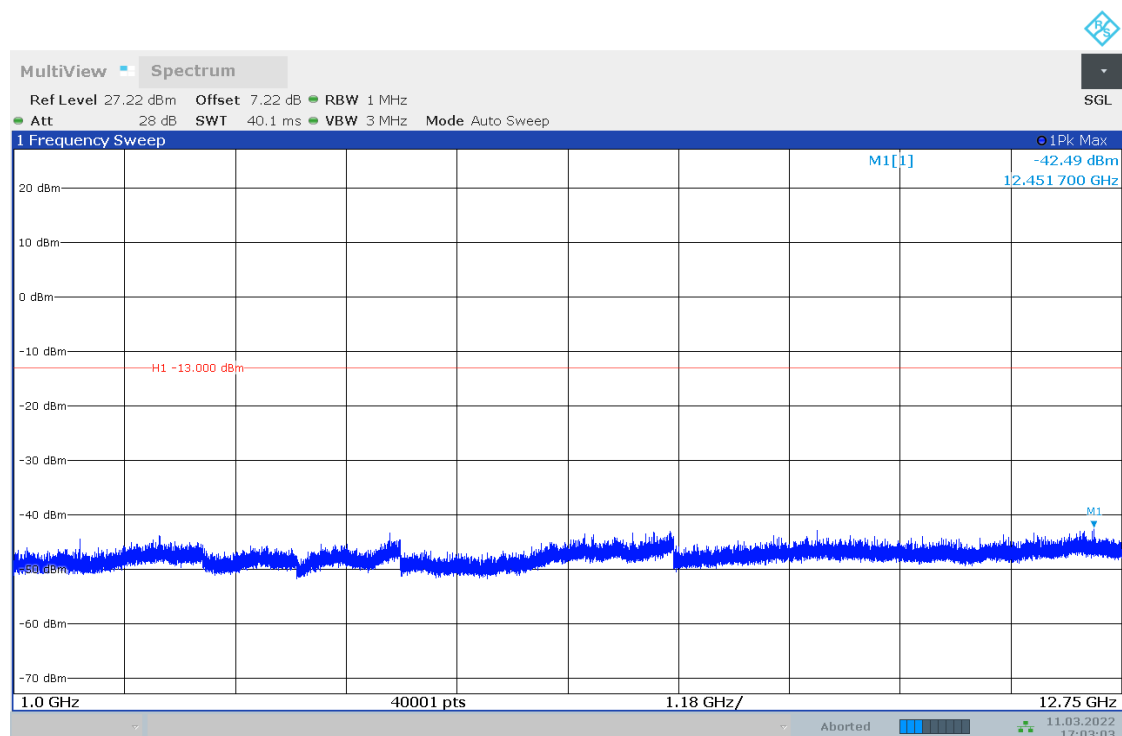


17:03:04 11.03.2022

6.2.36 TM2_1.4MHz_HCH_RB6#0

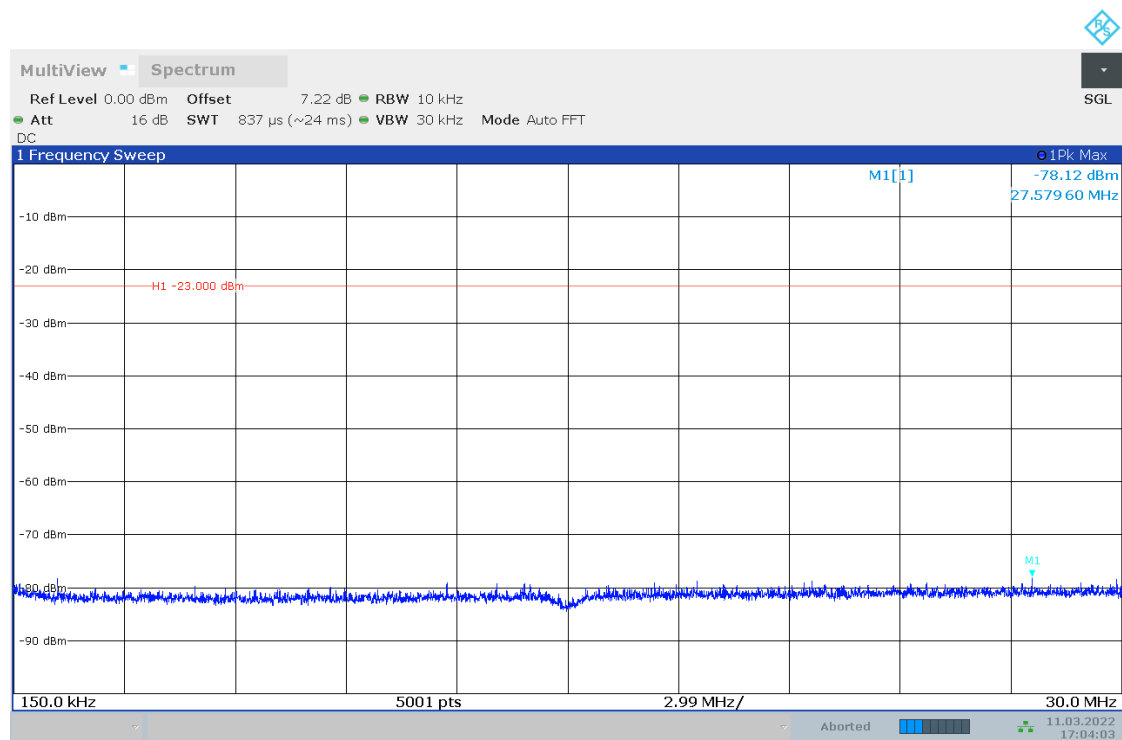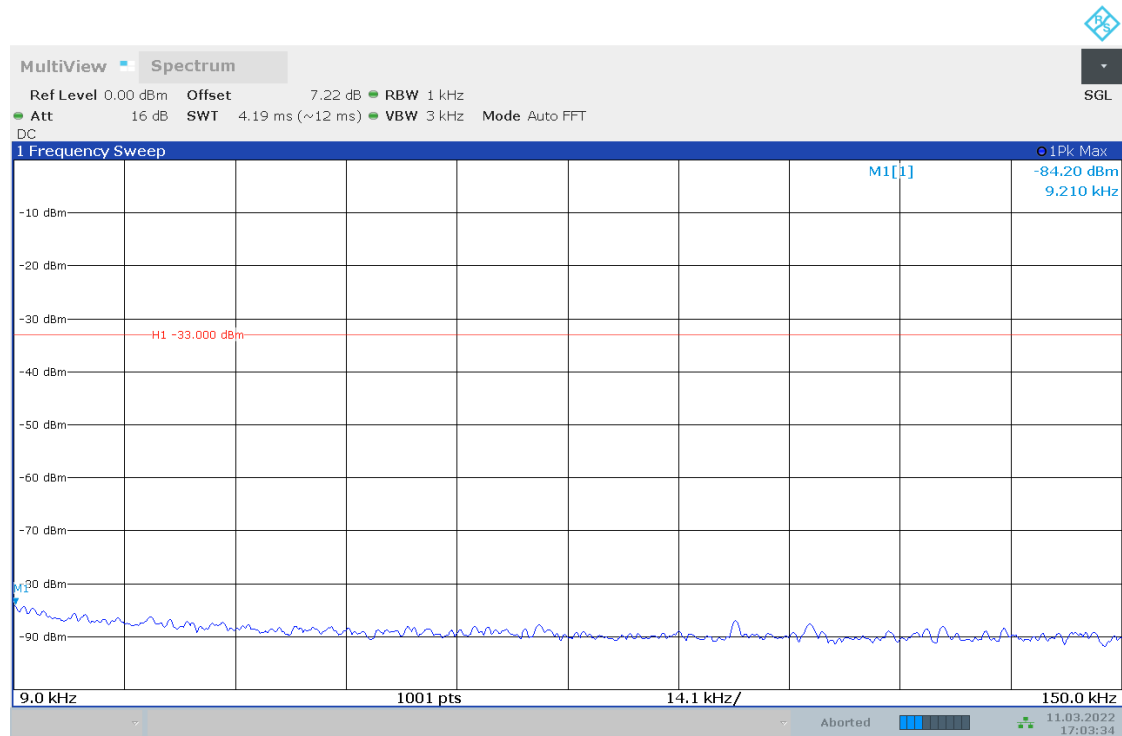

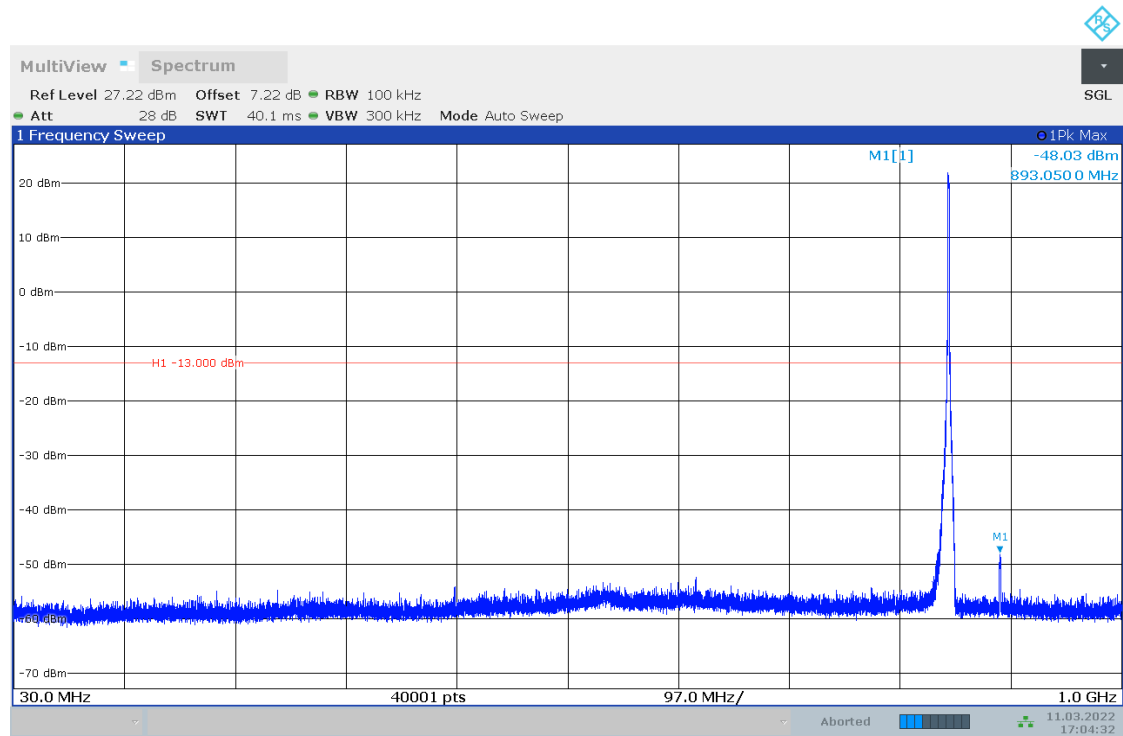


17:04:33 11.03.2022

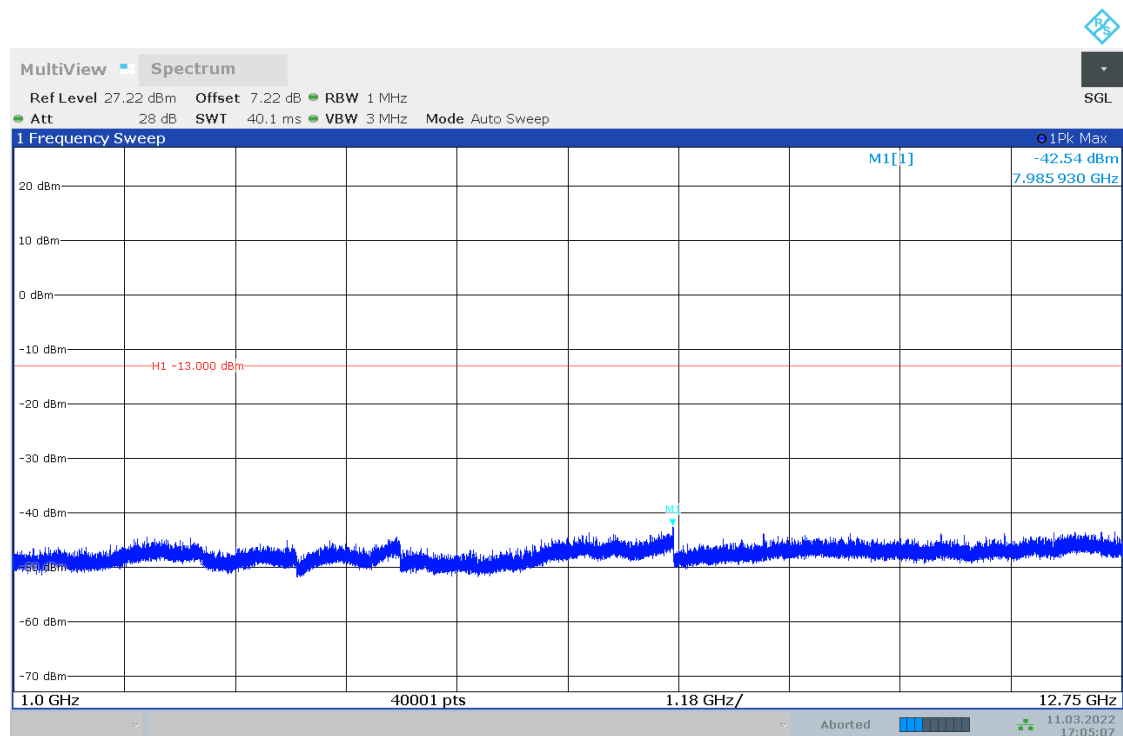


17:05:07 11.03.2022


6.2.37 TM2_5MHz_LCH_RB1#0

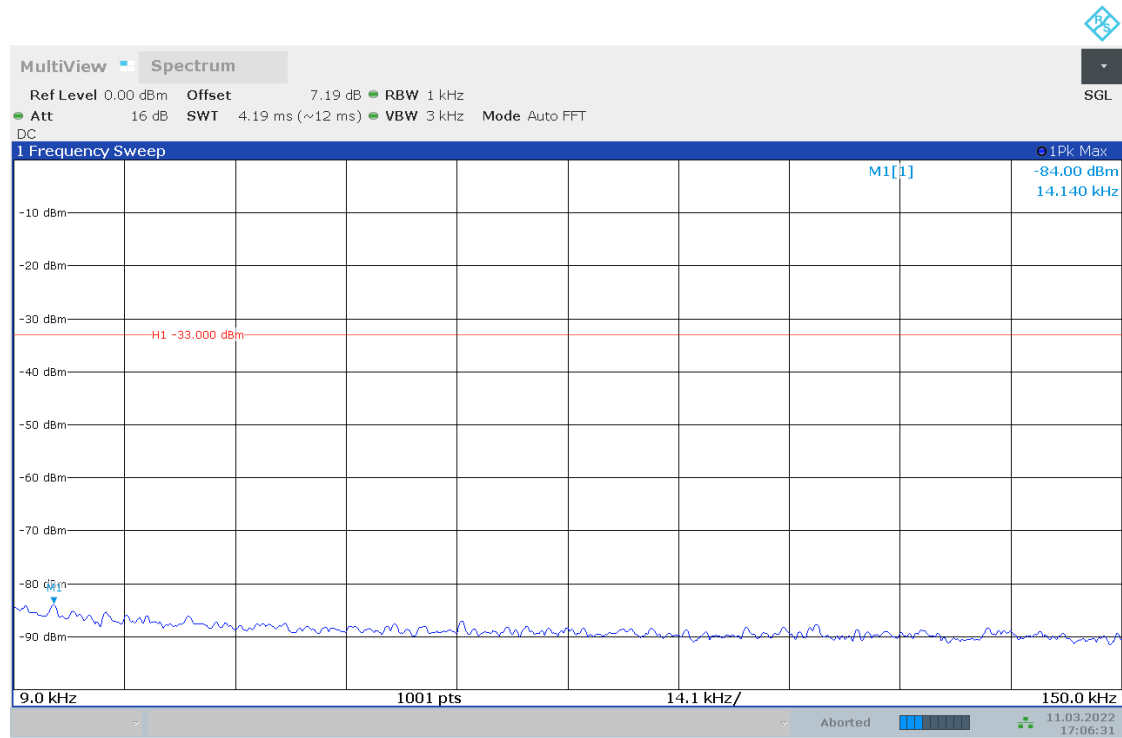


17:06:32 11.03.2022

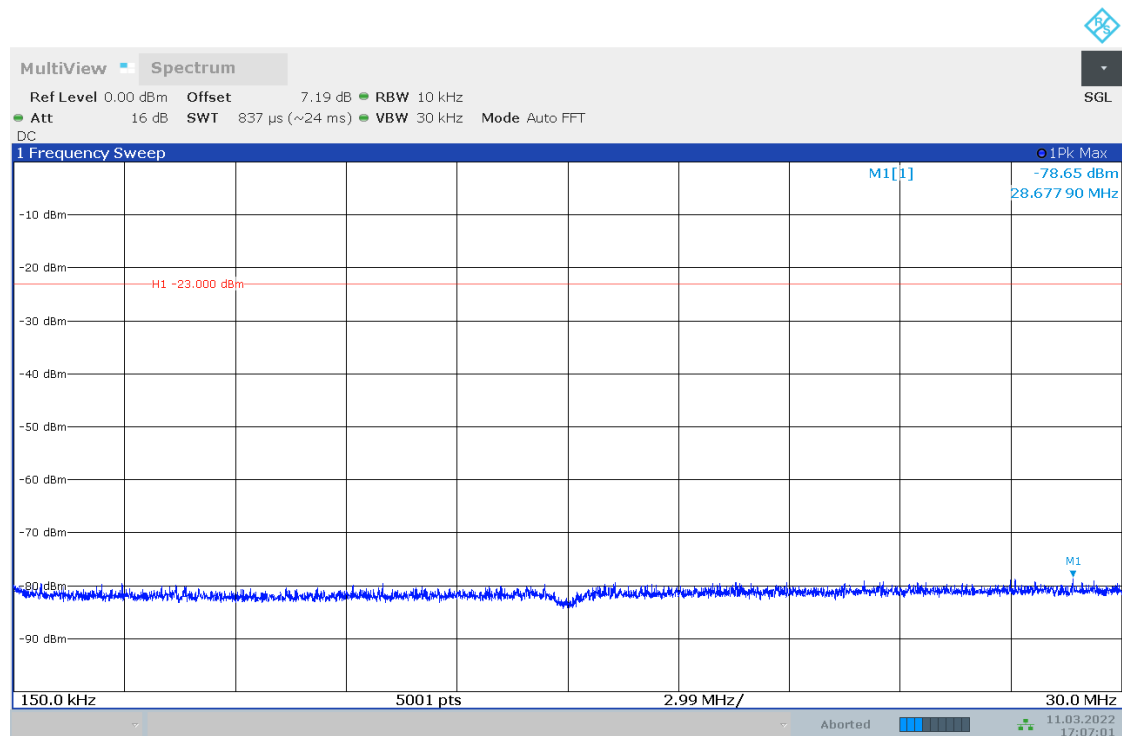

17:07:01 11.03.2022


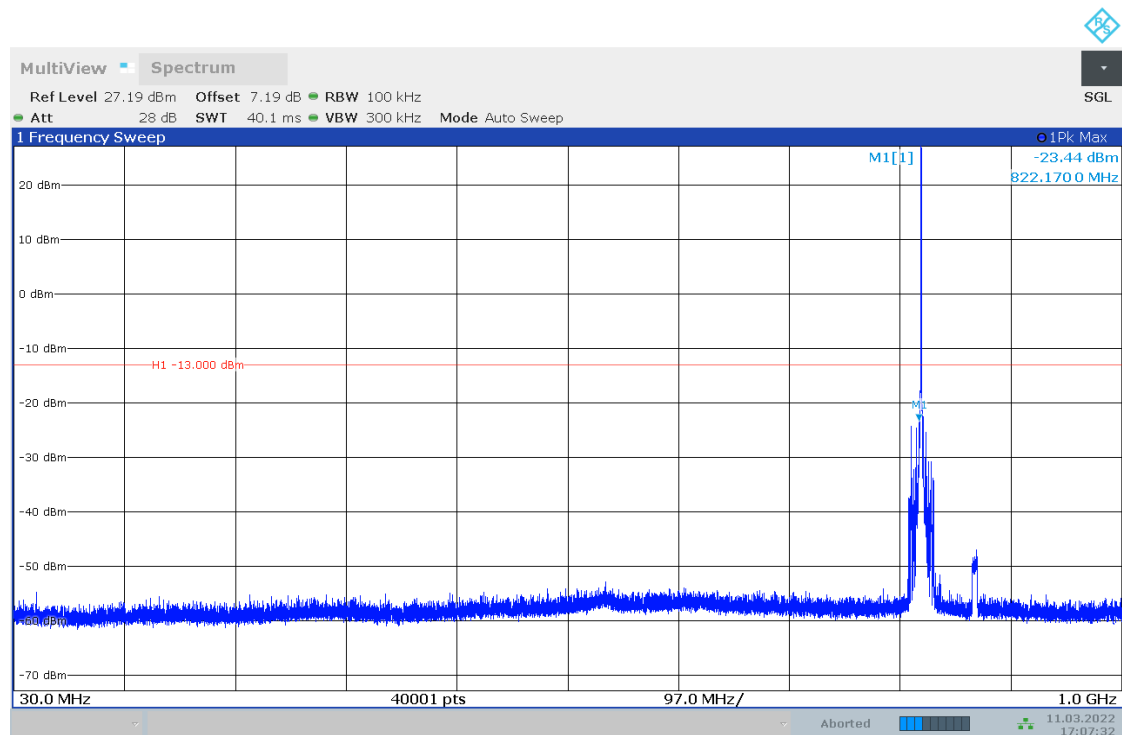



17:07:33 11.03.2022

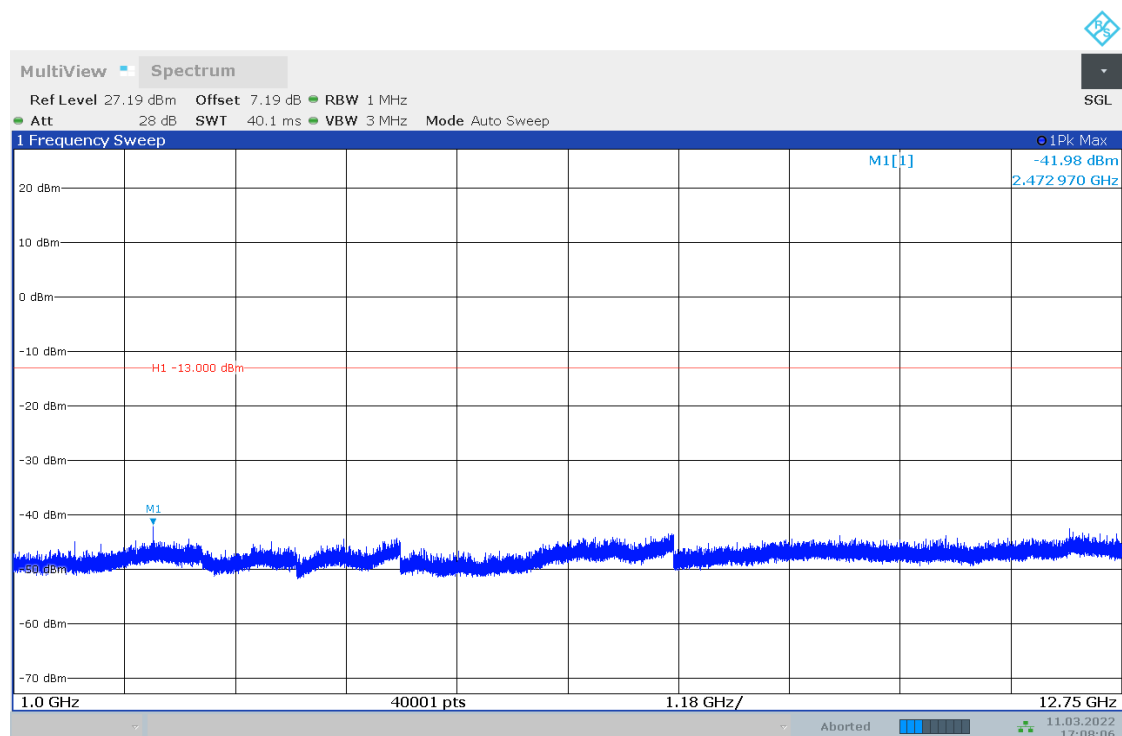


17:08:07 11.03.2022

6.2.38 TM2_5MHz_LCH_RB1#24

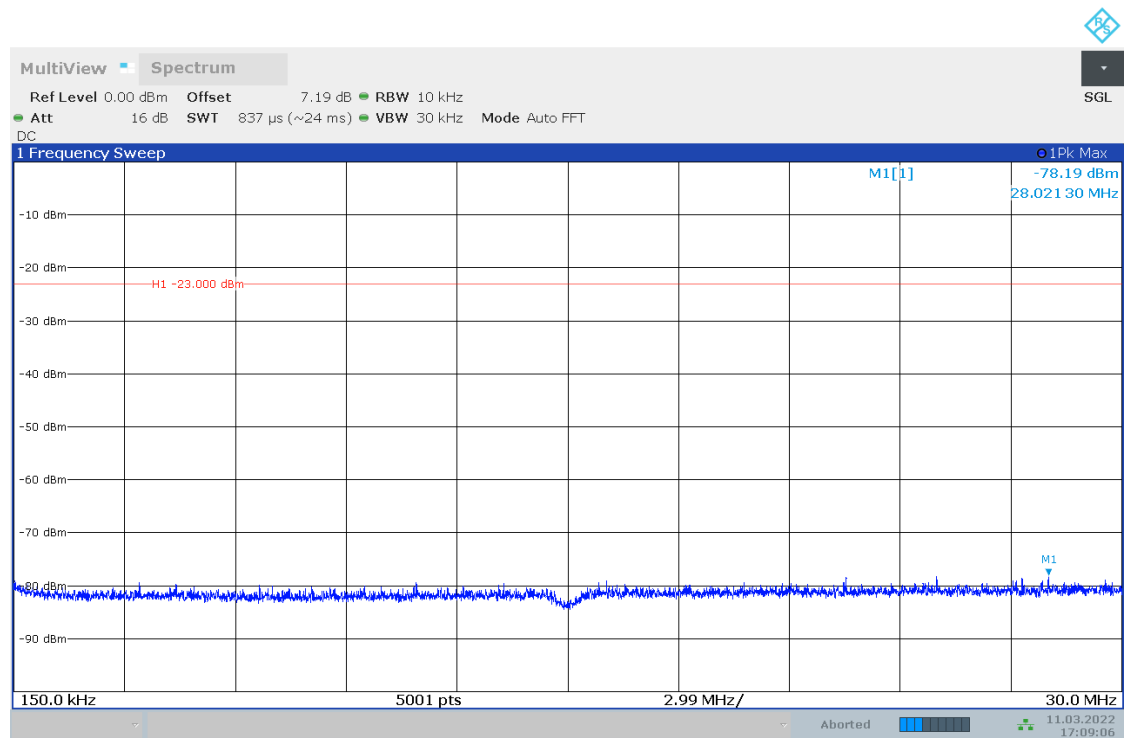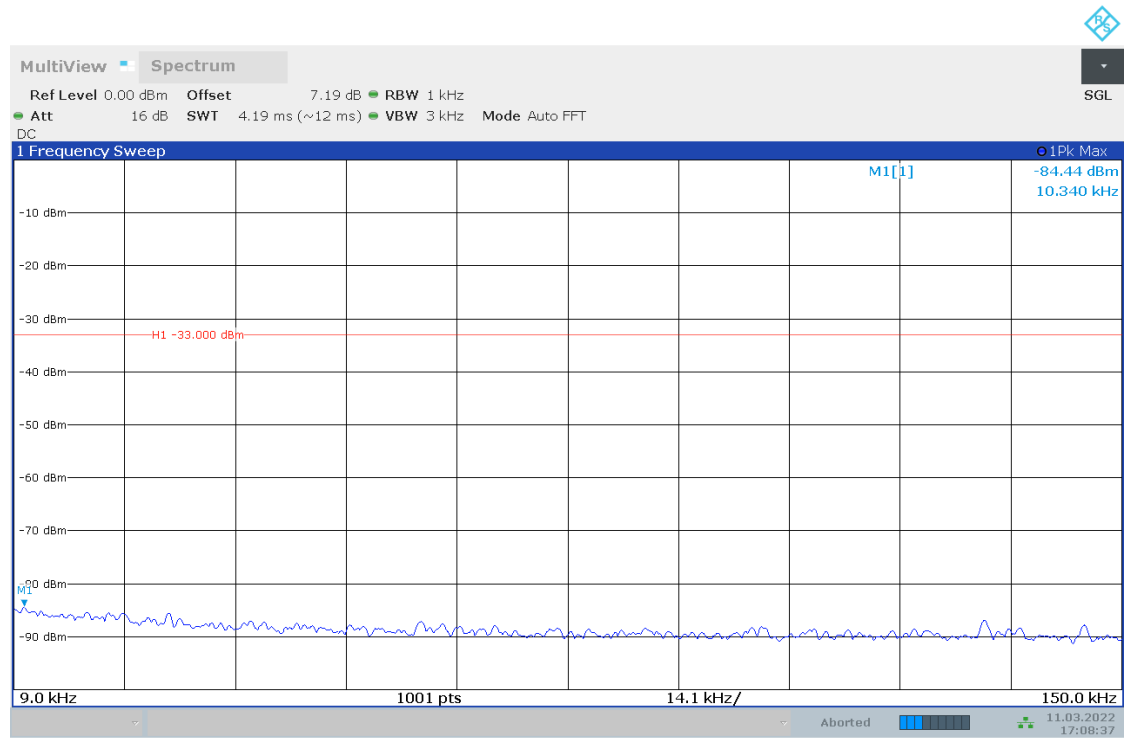


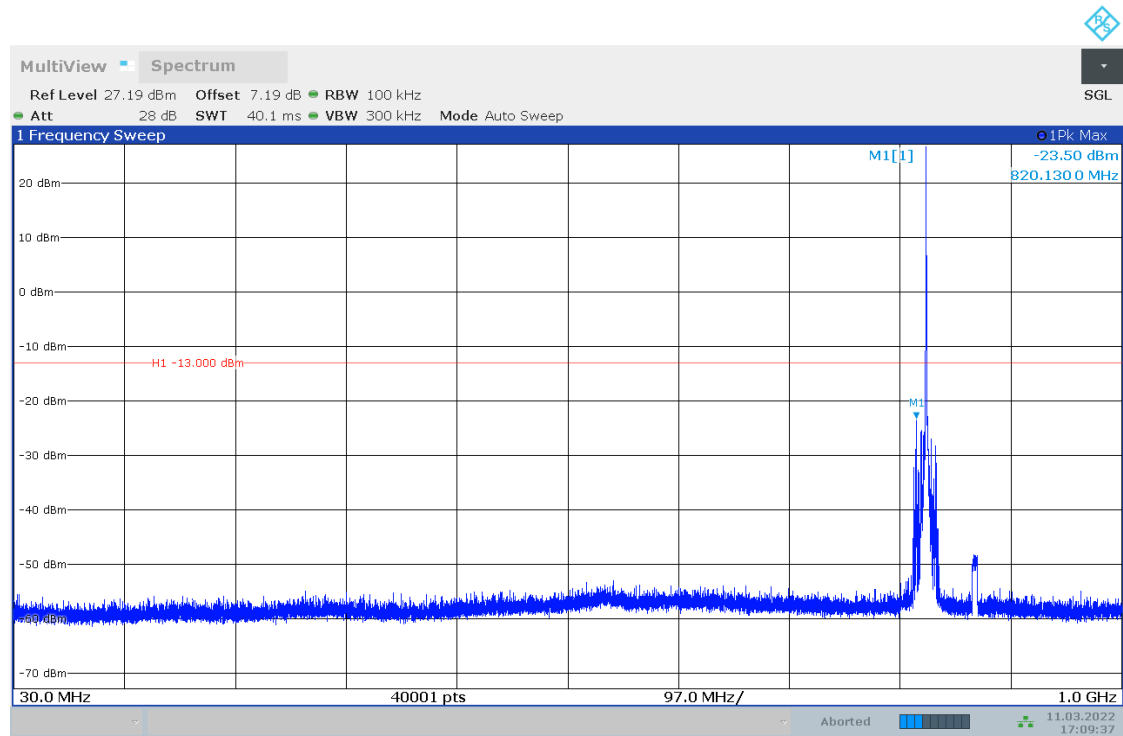



17:09:38 11.03.2022

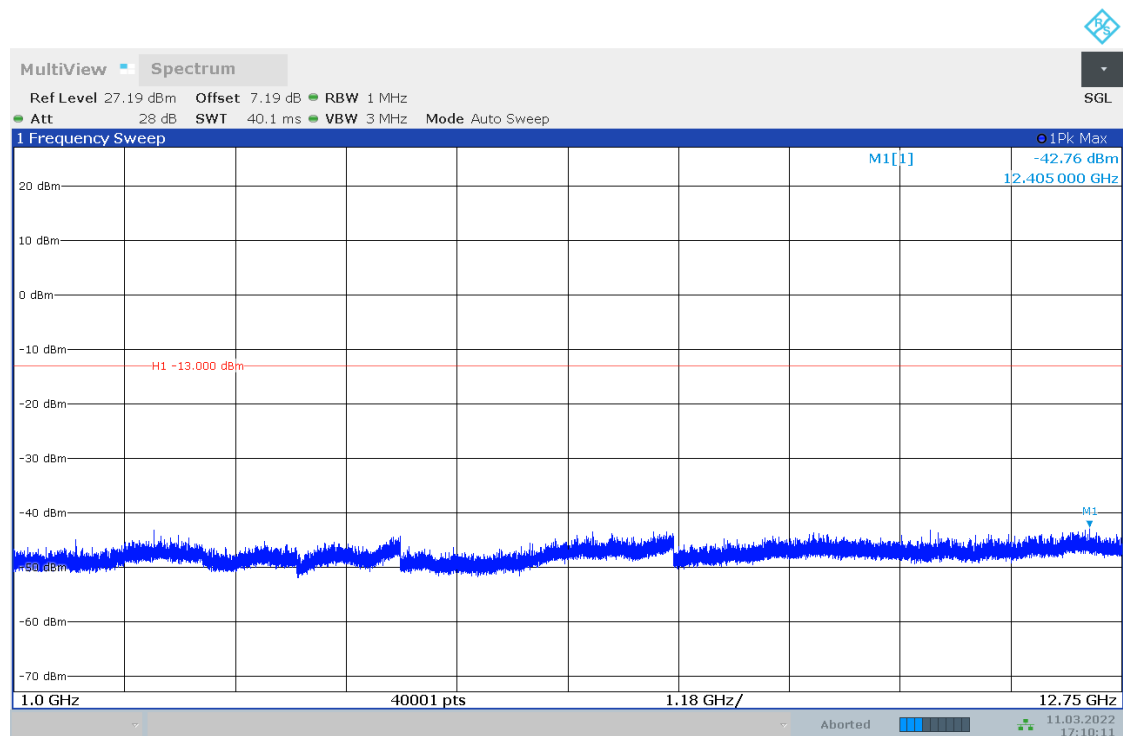


17:10:12 11.03.2022

6.2.39 TM2_5MHz_LCH_RB25#0

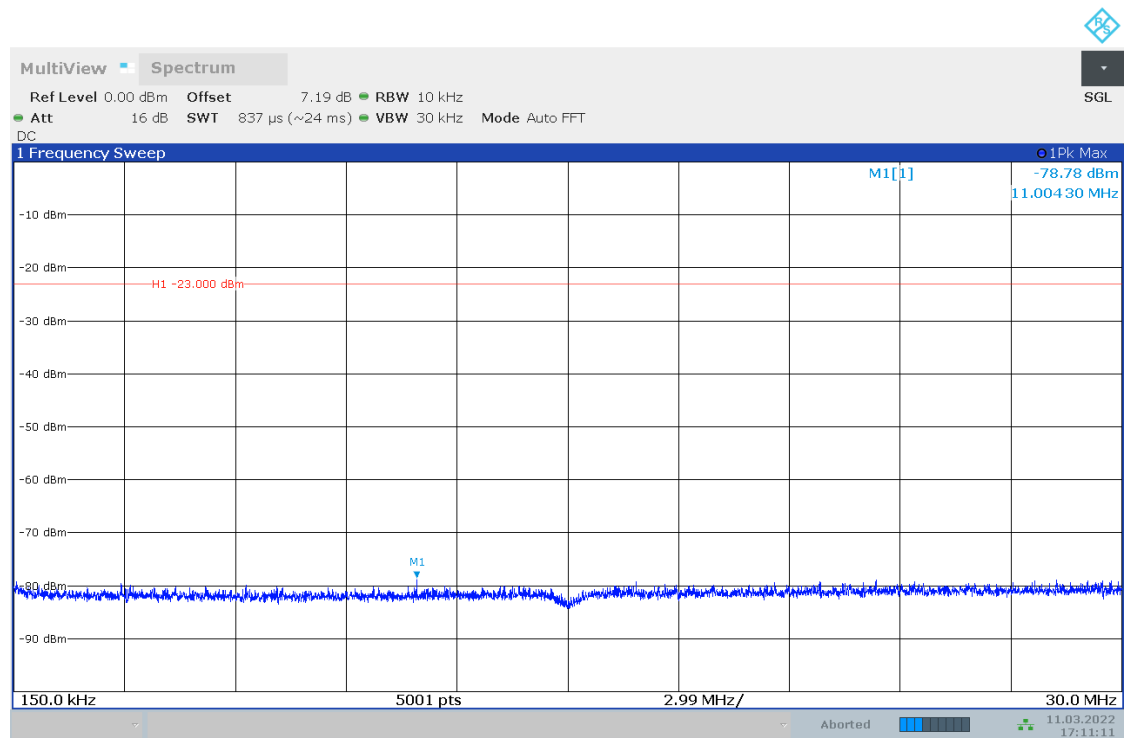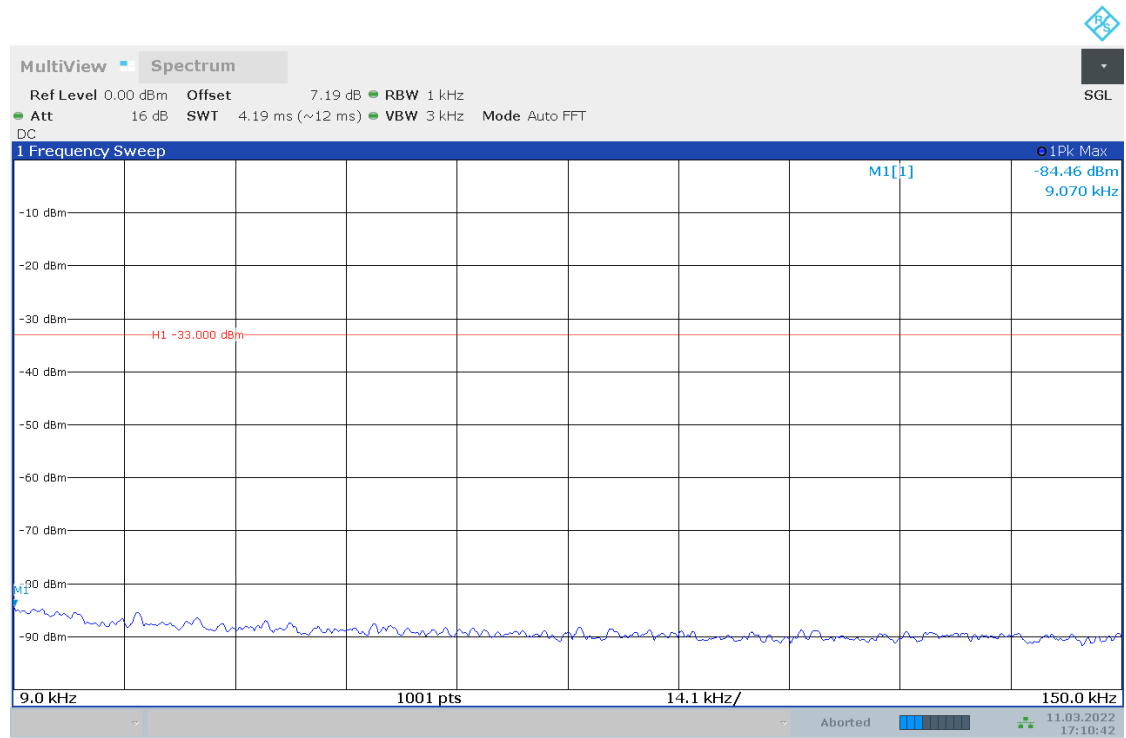


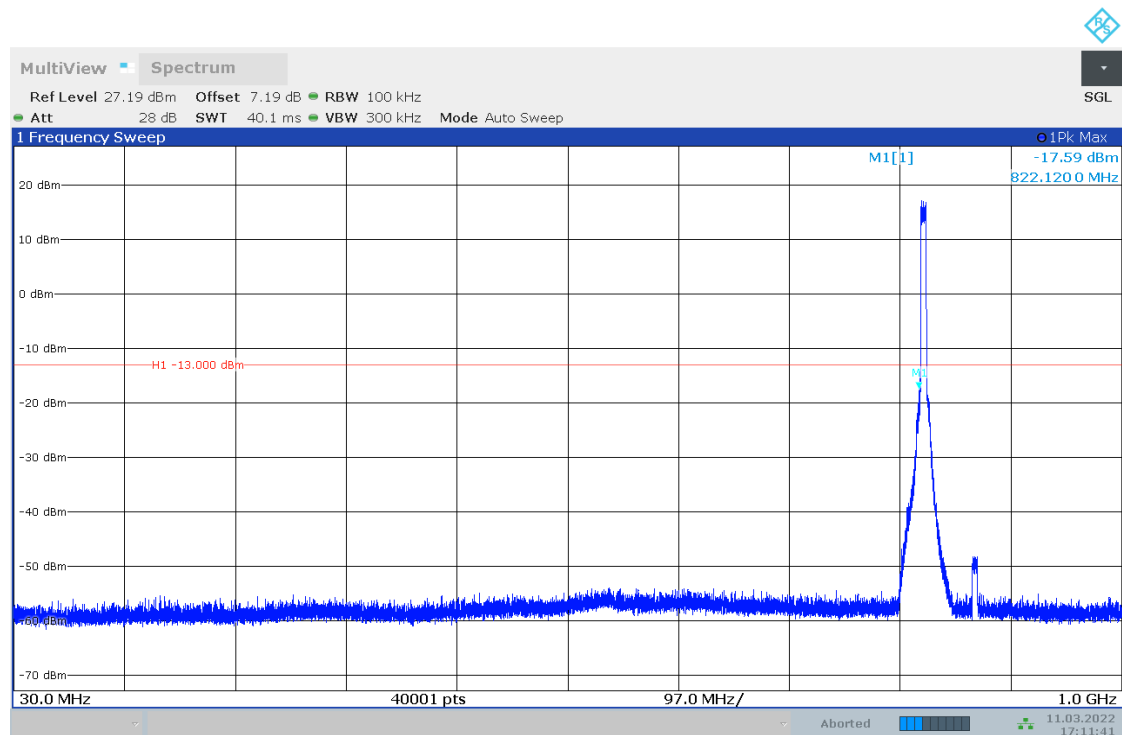



17:11:41 11.03.2022

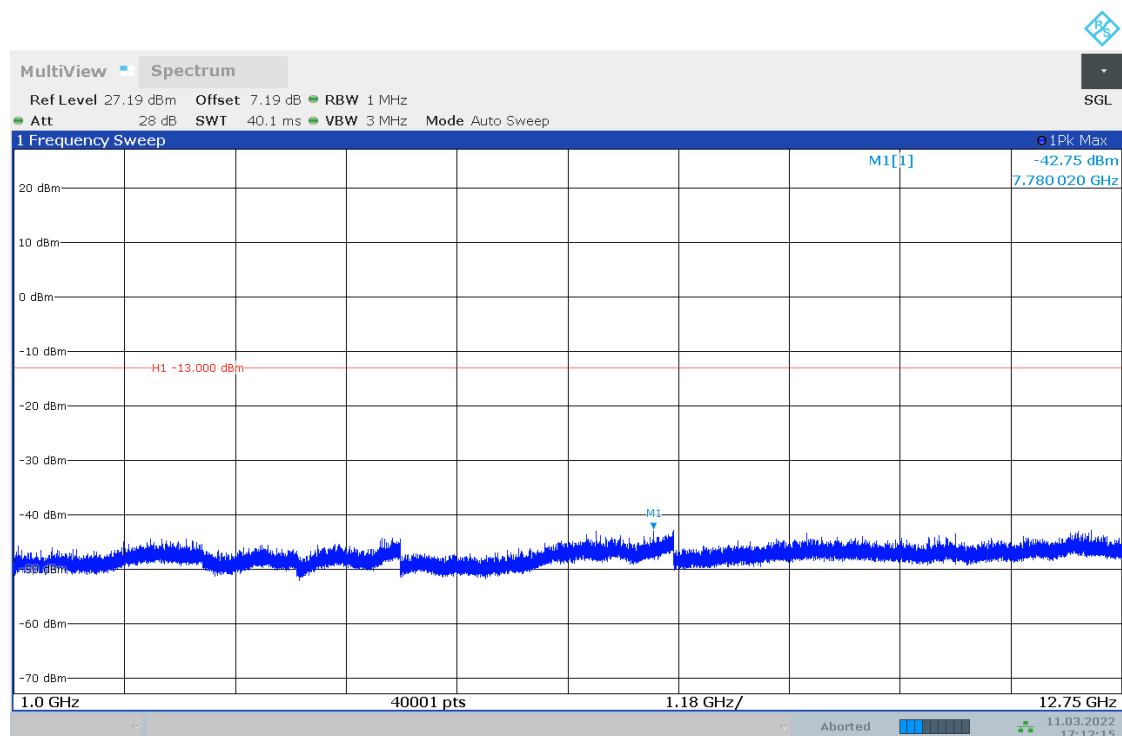


17:12:15 11.03.2022

6.2.40 TM2_5MHz_MCH_RB1#0

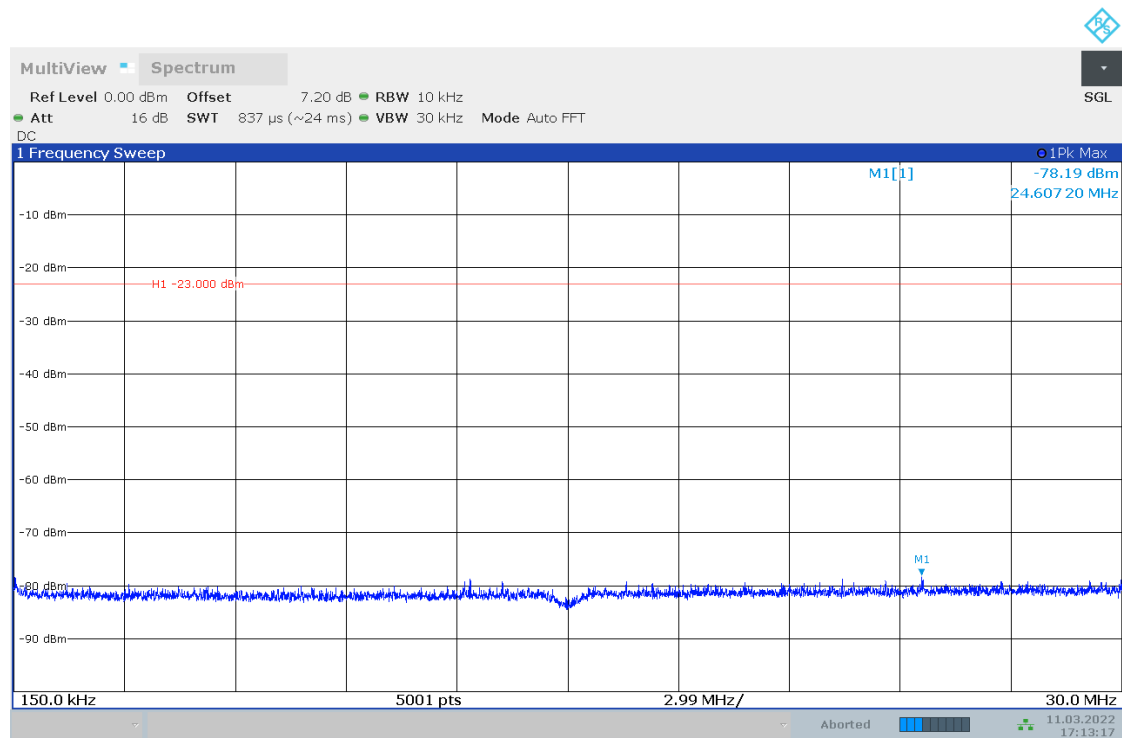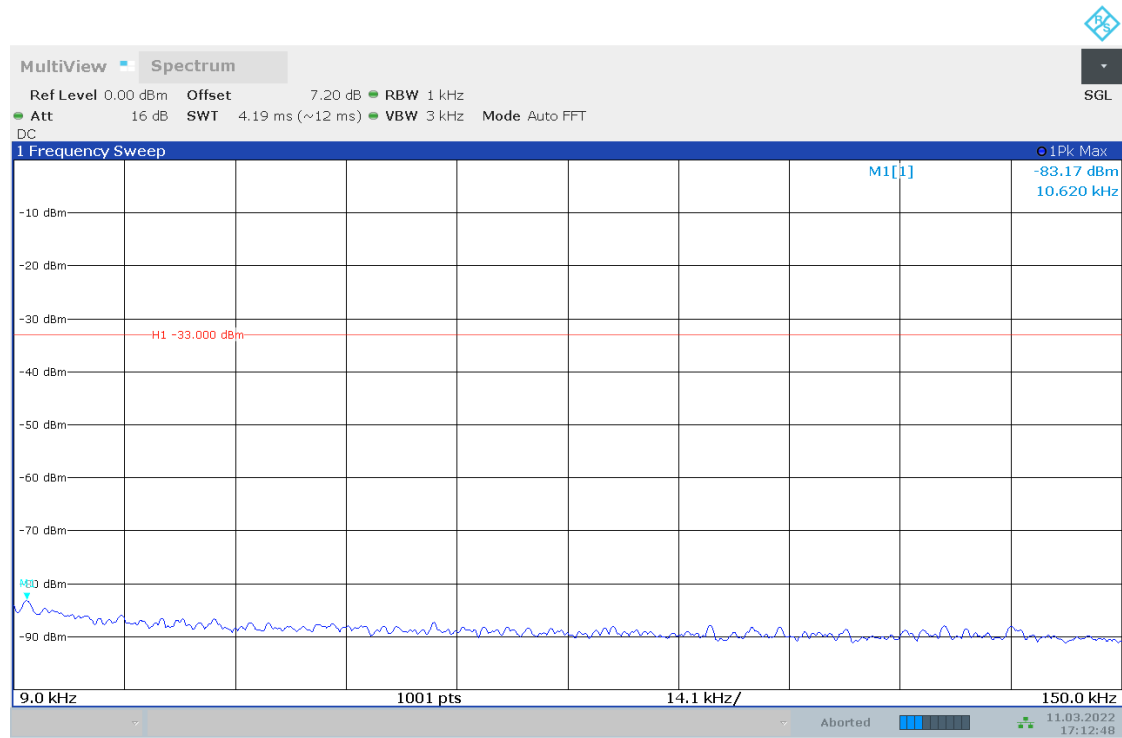


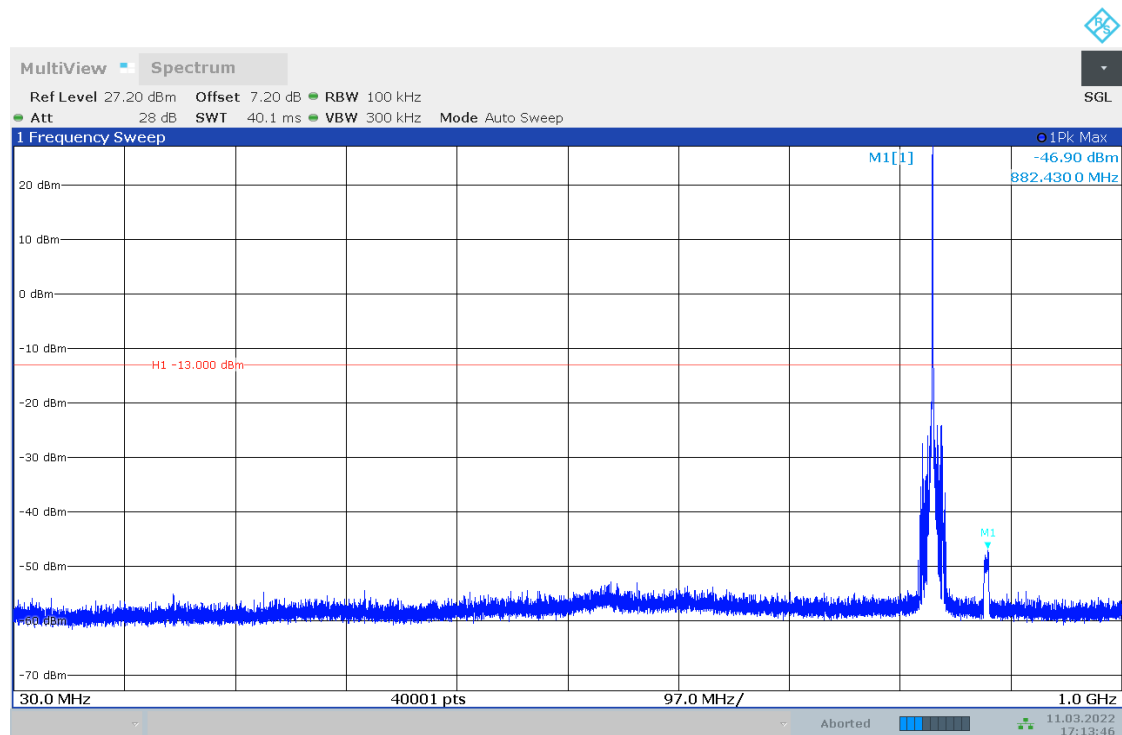



17:13:47 11.03.2022

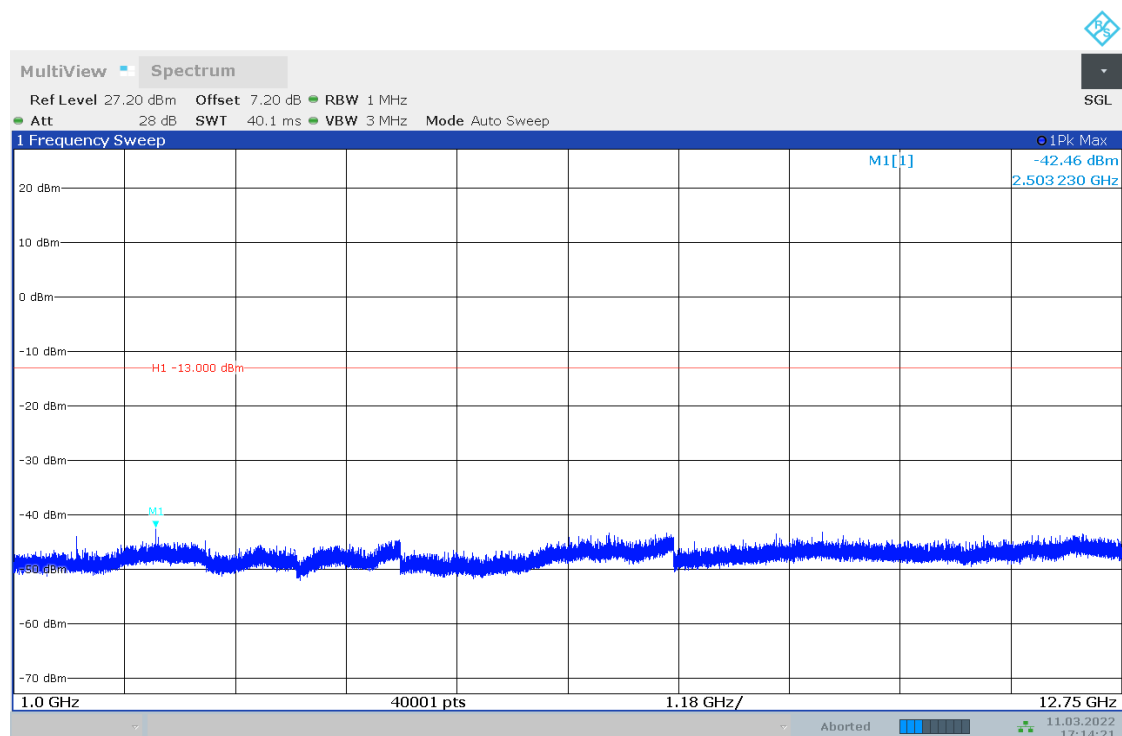


17:14:21 11.03.2022

6.2.41 TM2_5MHz_MCH_RB1#24

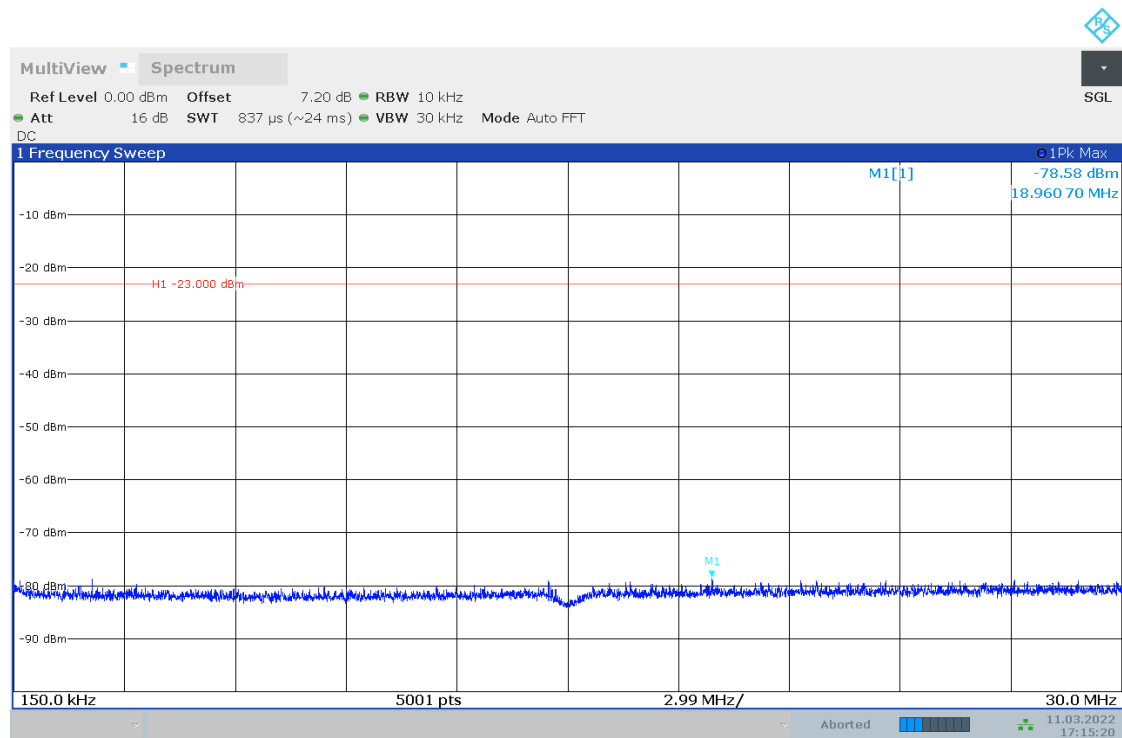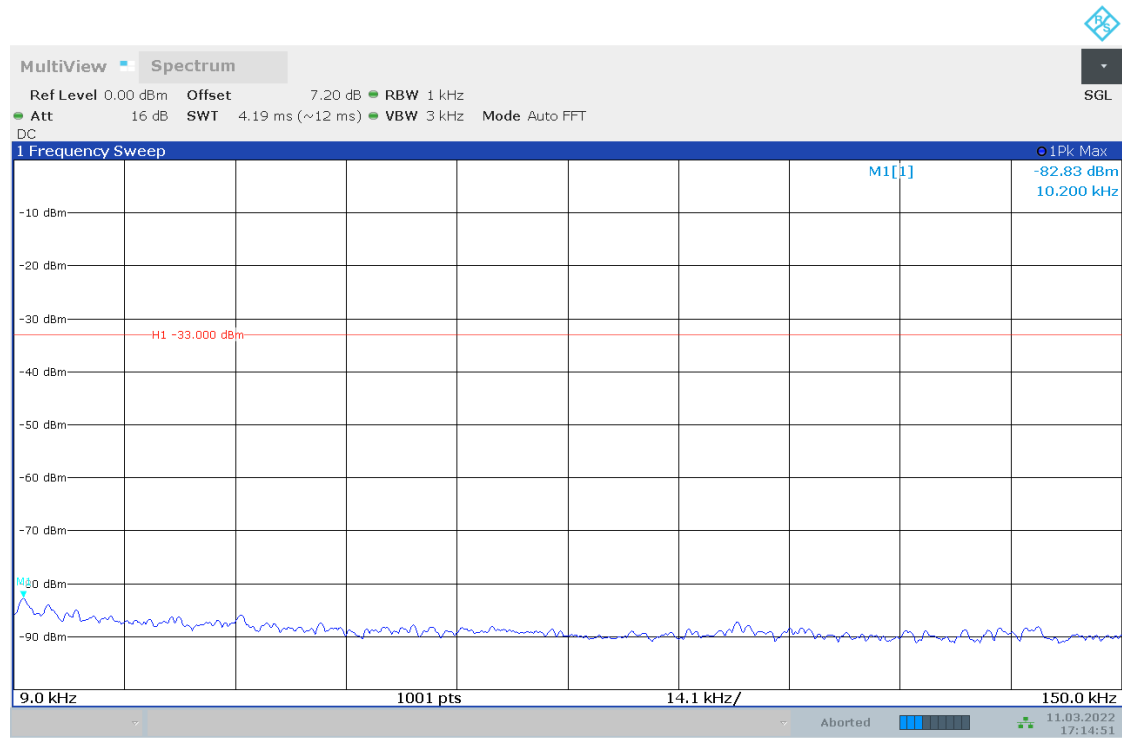


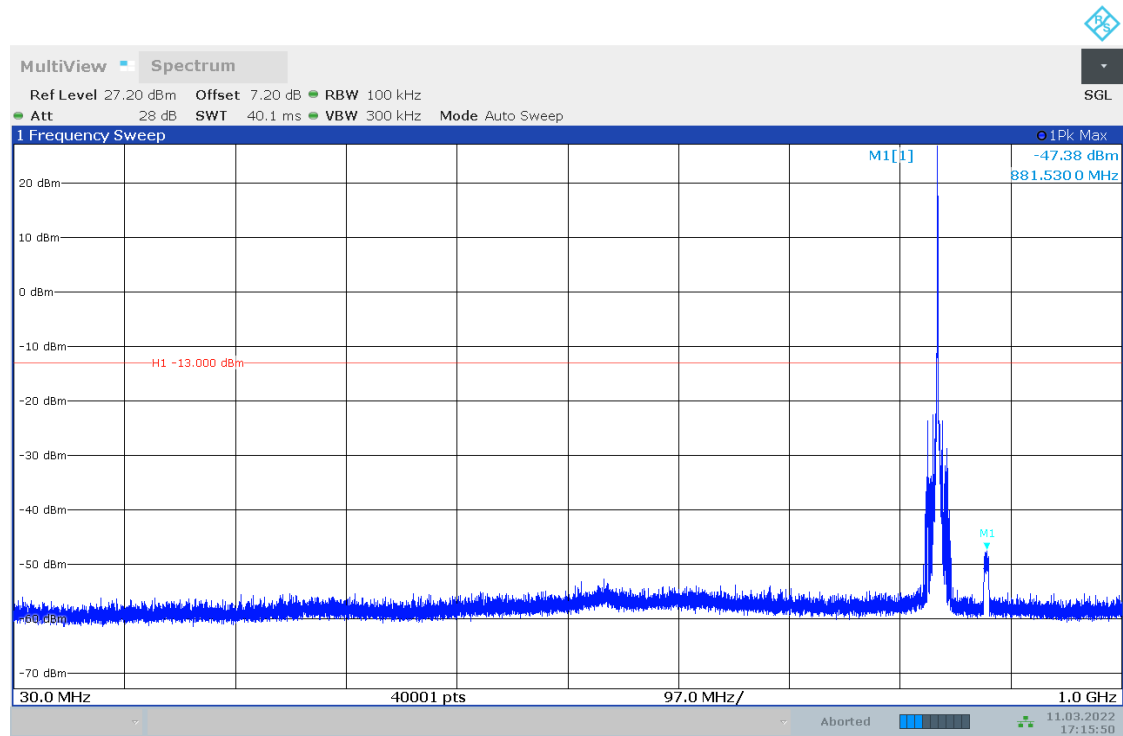



17:15:51 11.03.2022

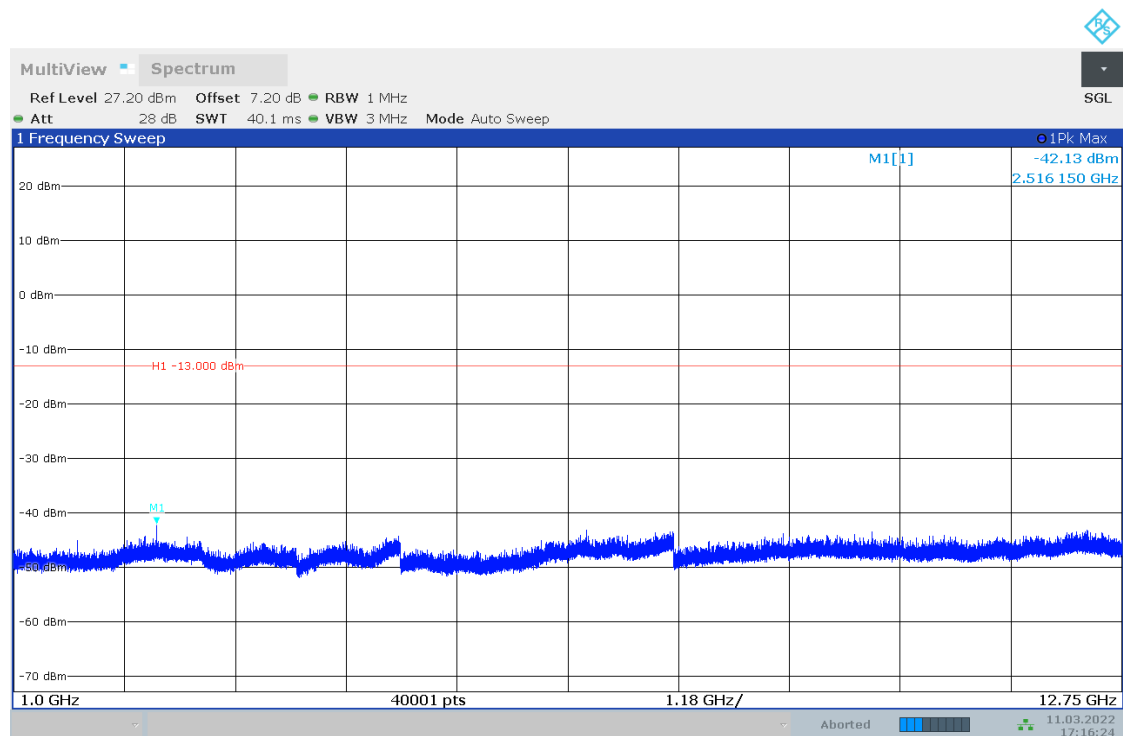


17:16:25 11.03.2022

6.2.42 TM2_5MHz_MCH_RB25#0

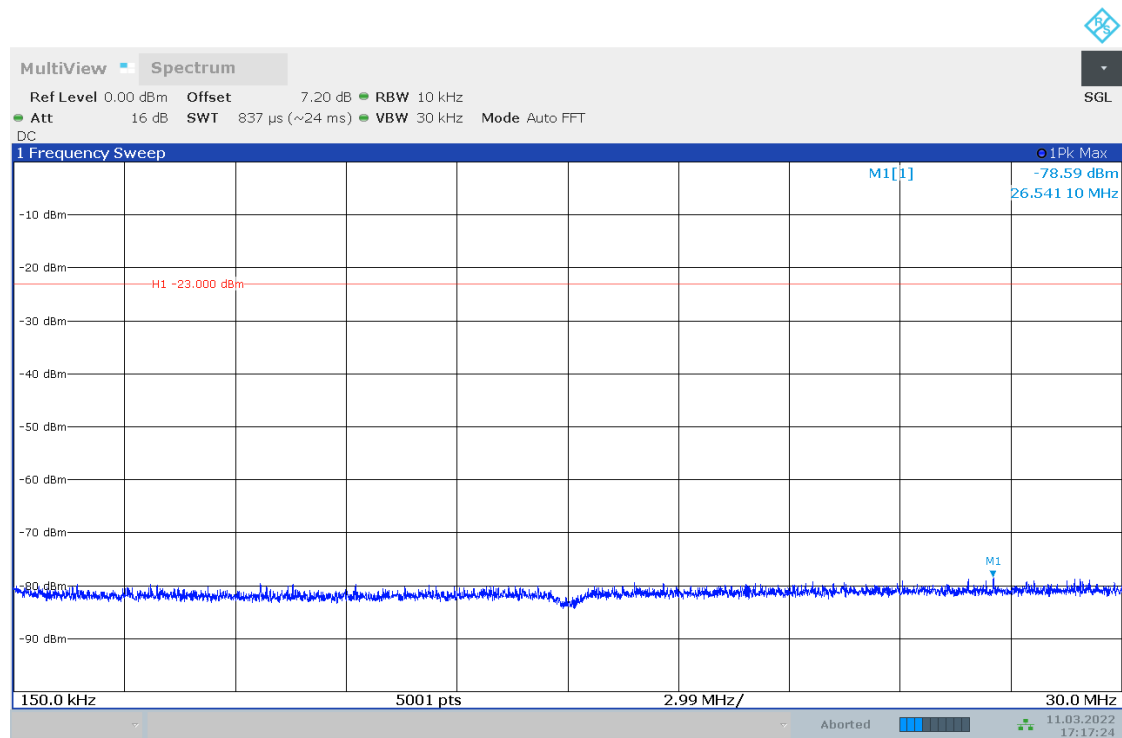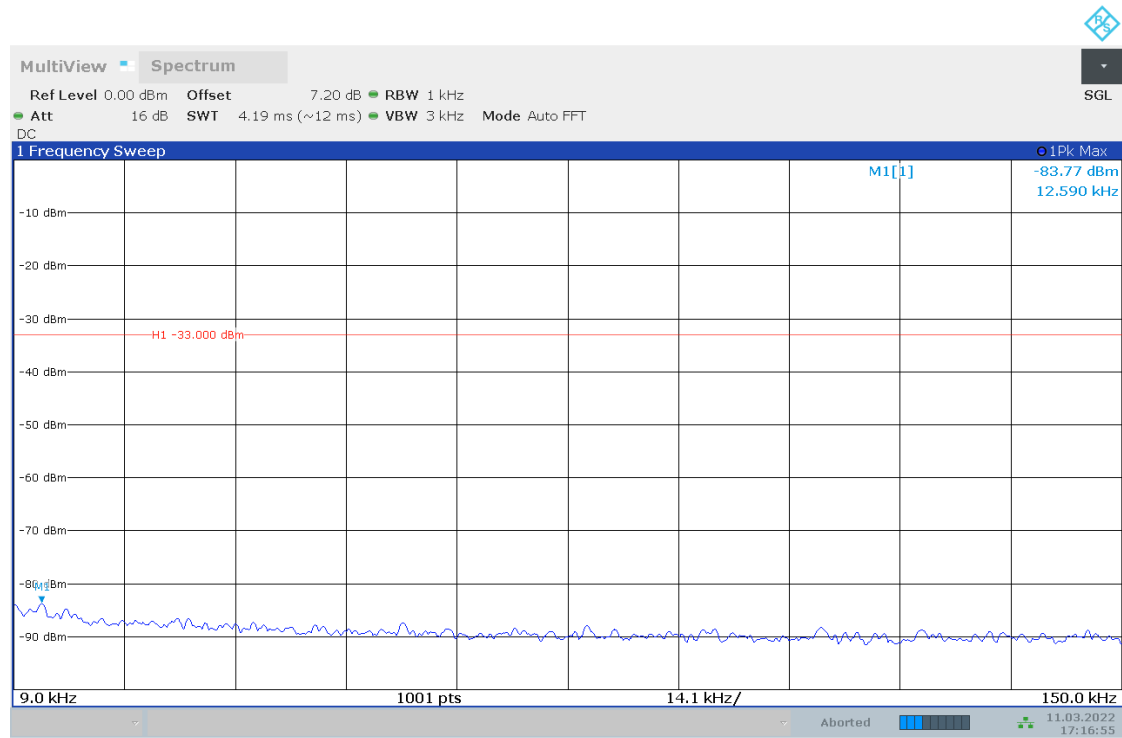


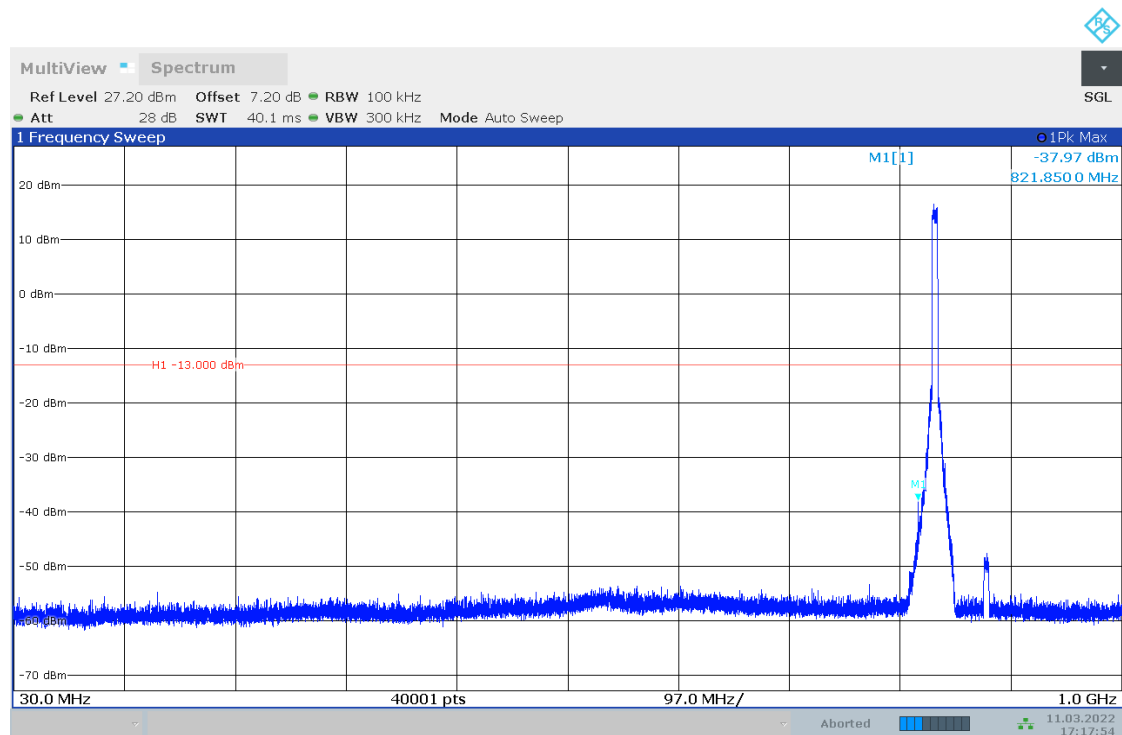



17:17:55 11.03.2022

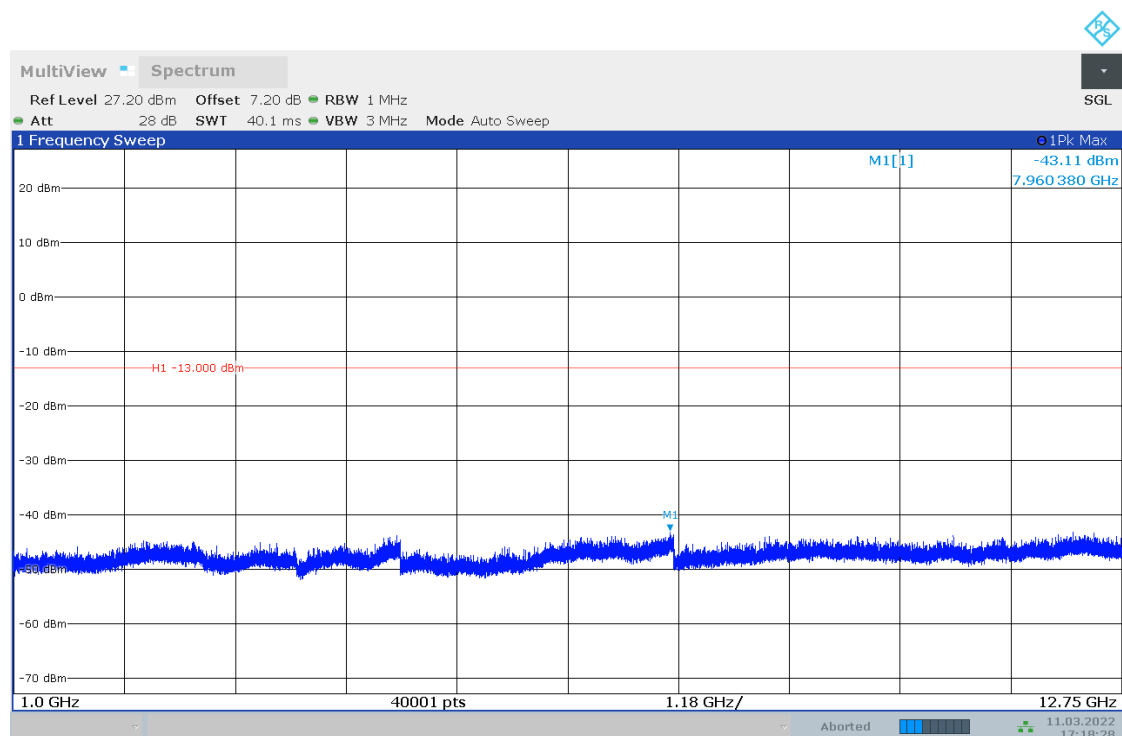


17:18:29 11.03.2022

6.2.43 TM2_5MHz_HCH_RB1#0

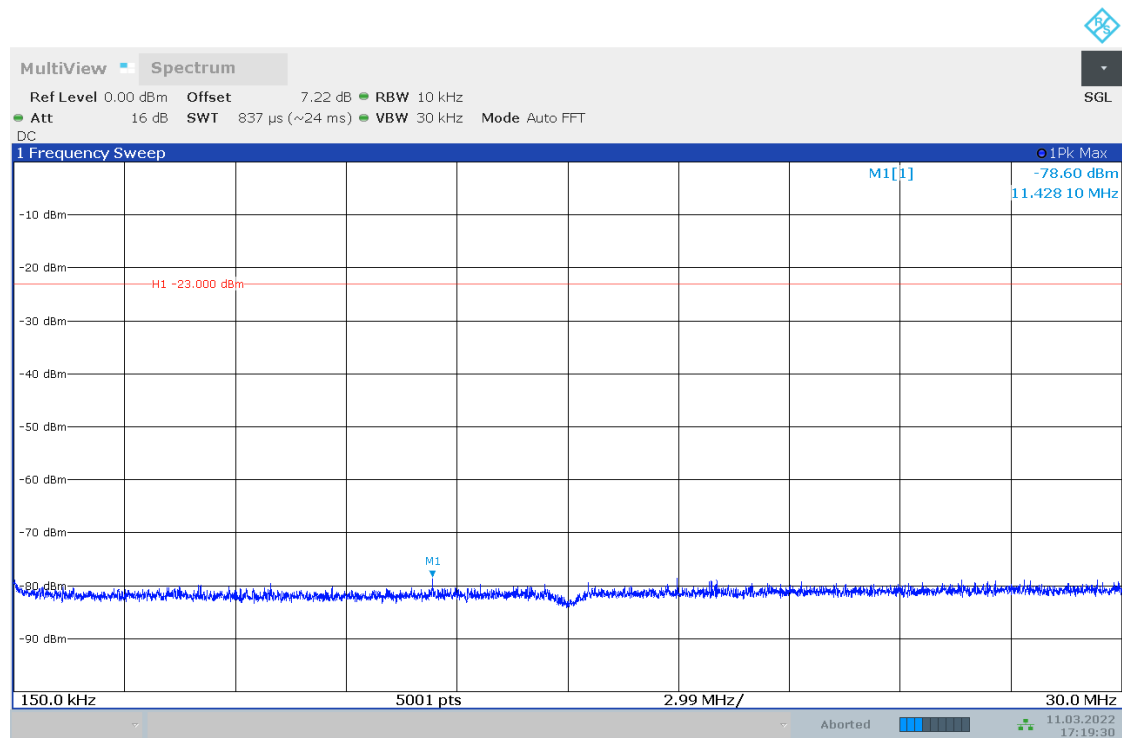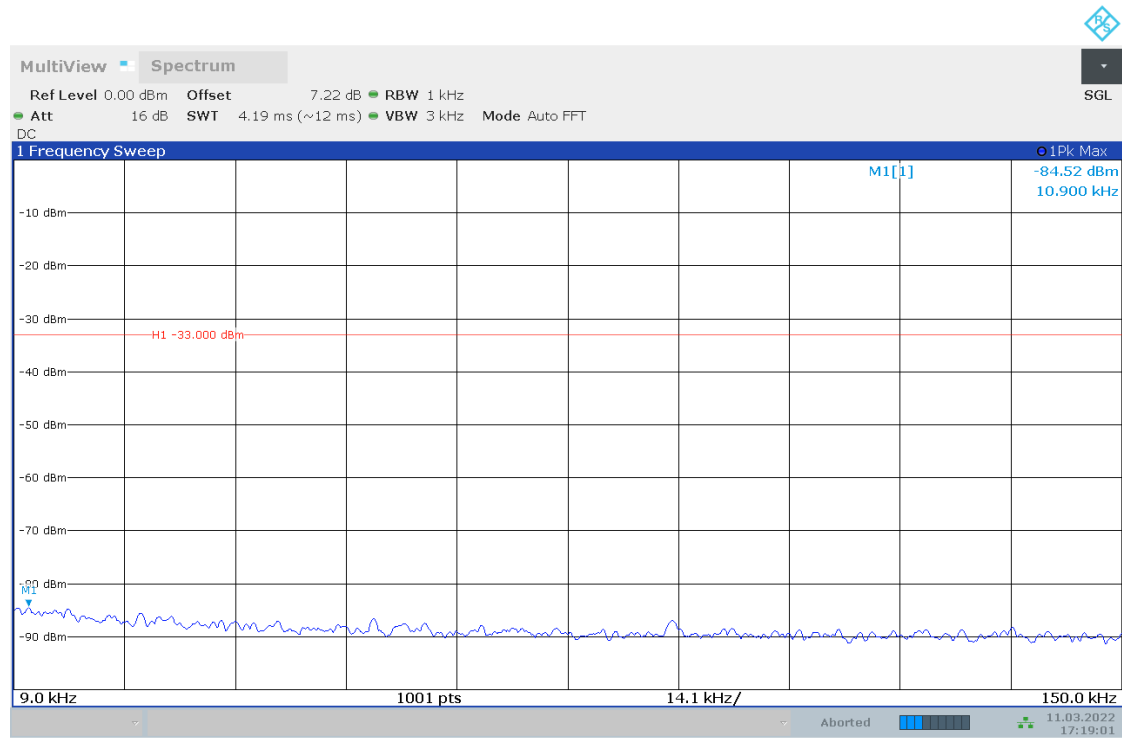


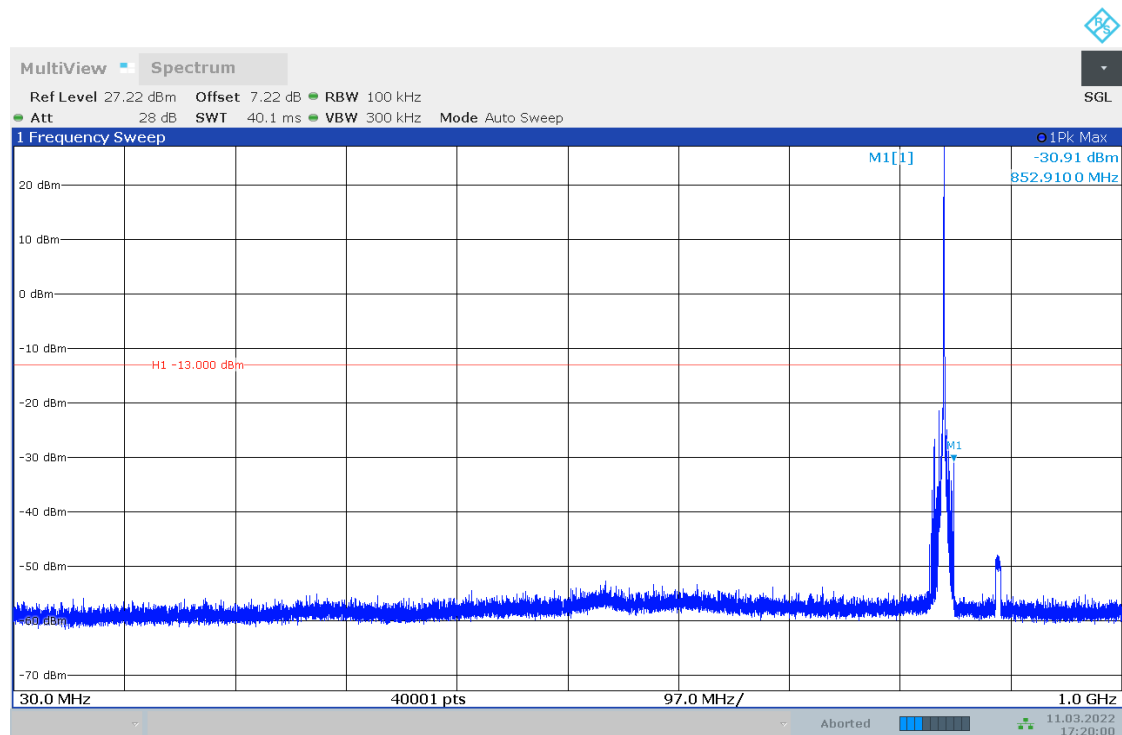



17:20:01 11.03.2022

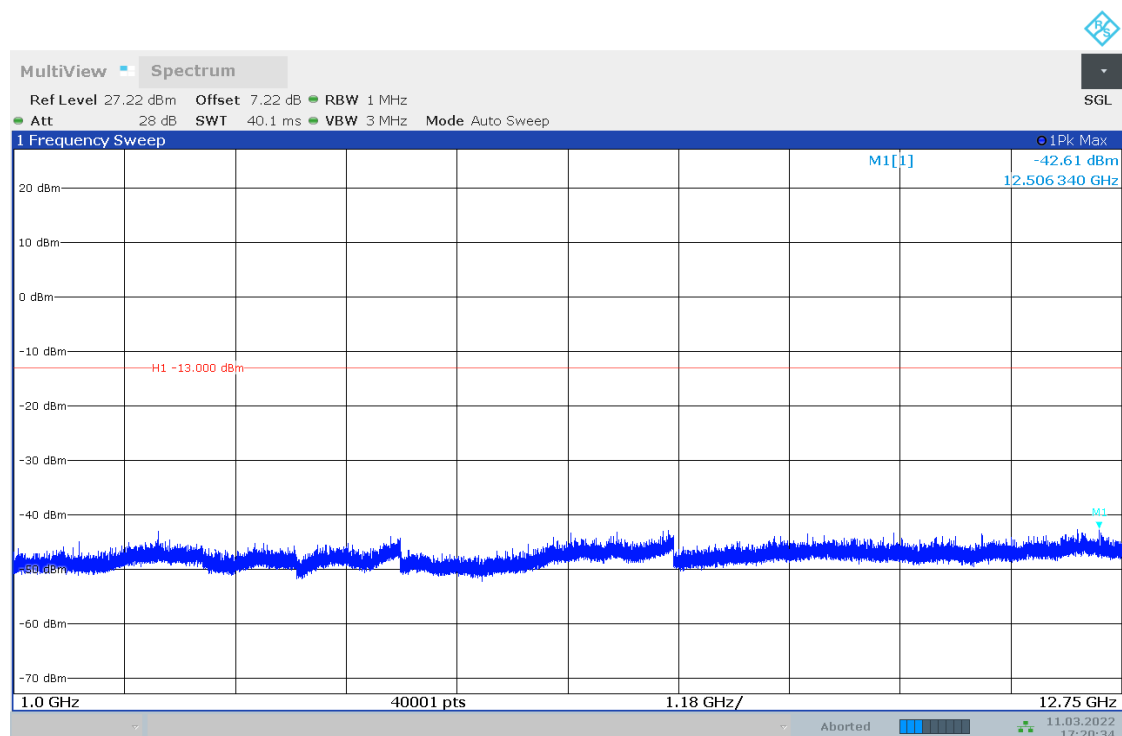


17:20:35 11.03.2022

6.2.44 TM2_5MHz_HCH_RB1#24

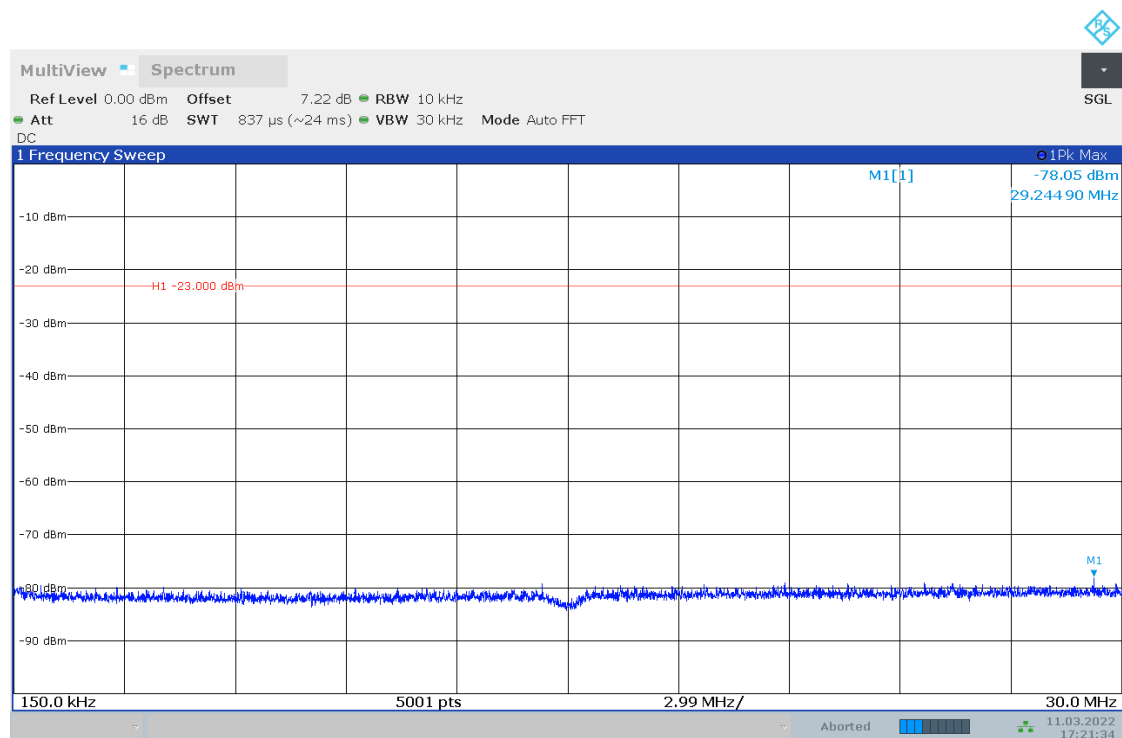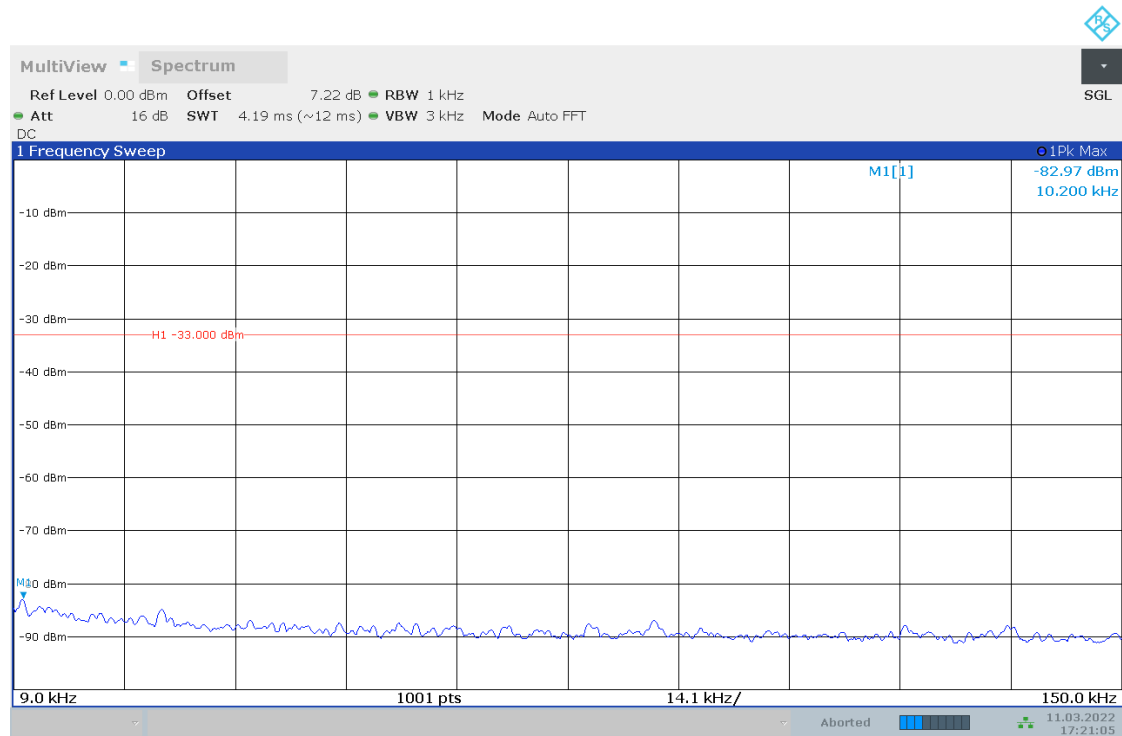

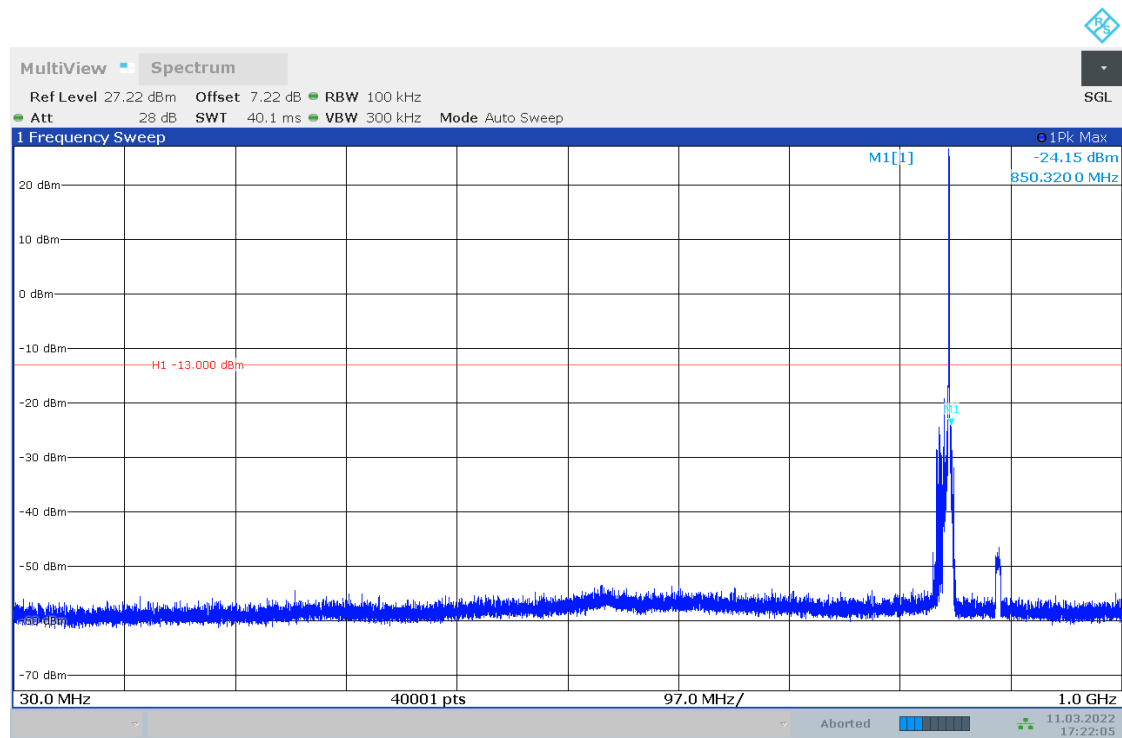


17:22:06 11.03.2022

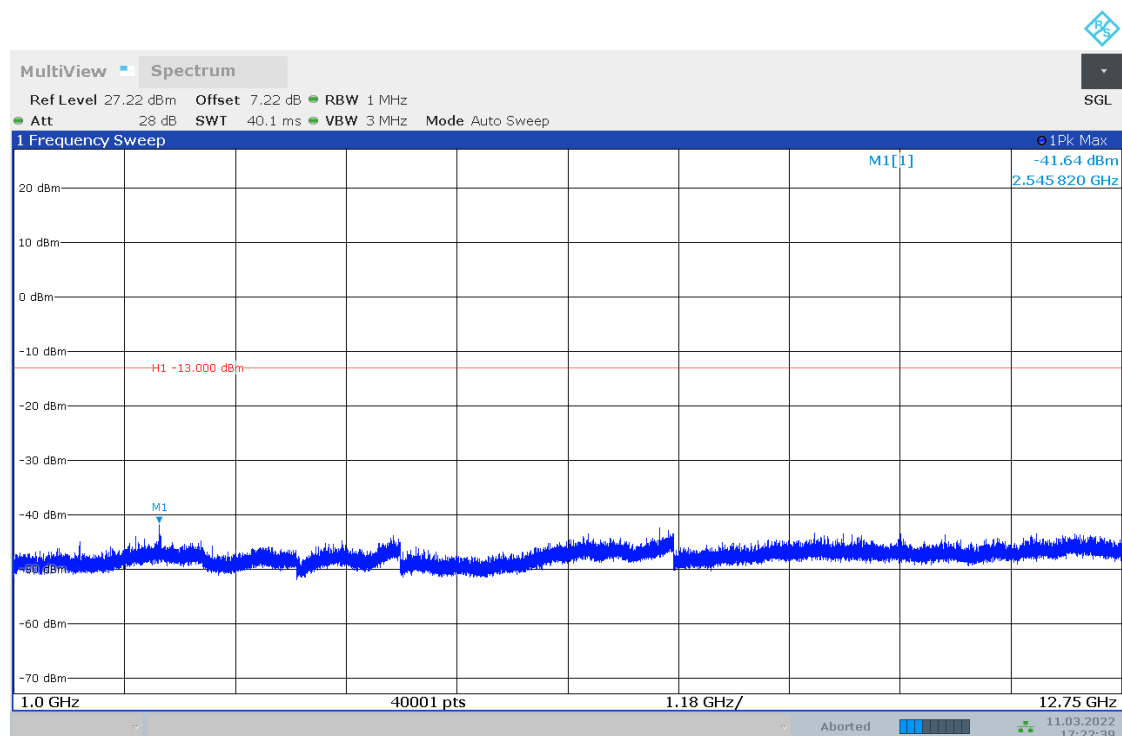


17:22:40 11.03.2022


6.2.45 TM2_5MHz_HCH_RB25#0

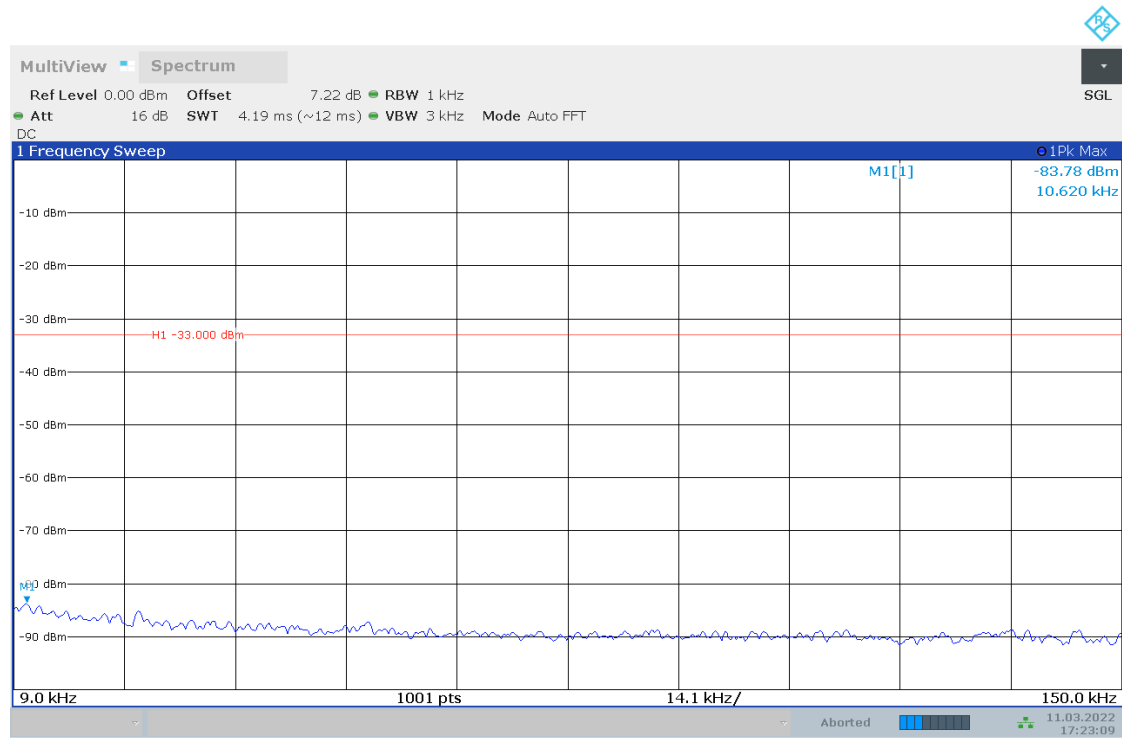


17:23:10 11.03.2022

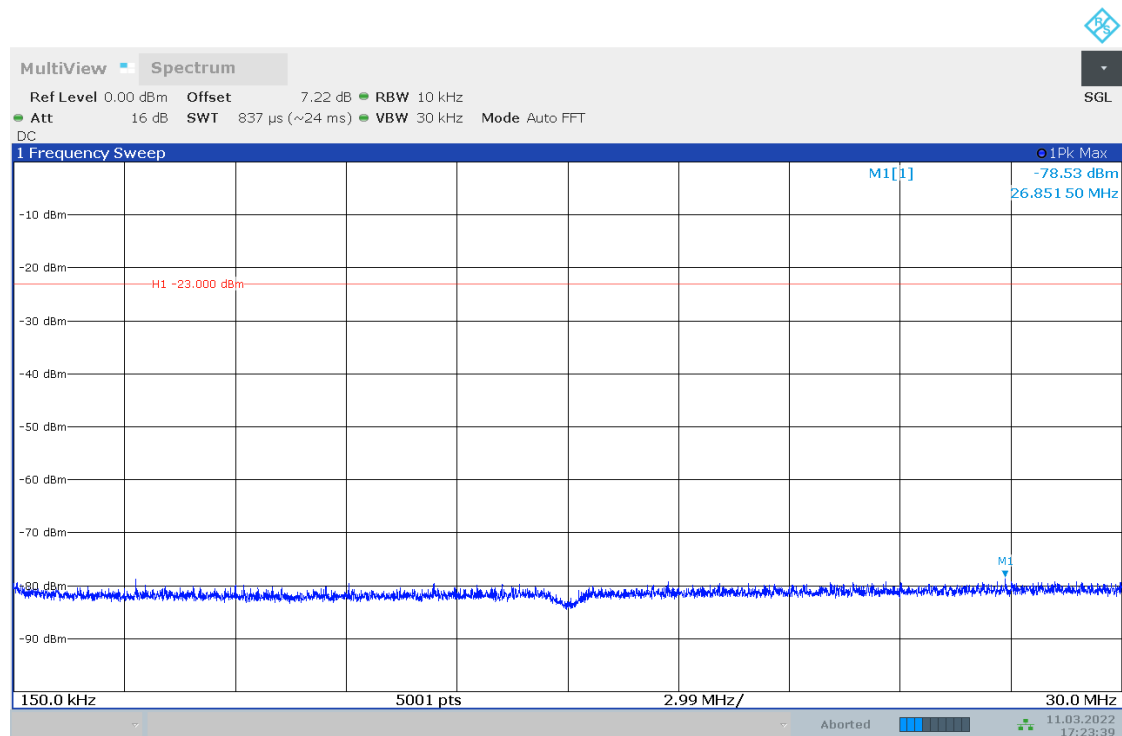

17:23:40 11.03.2022


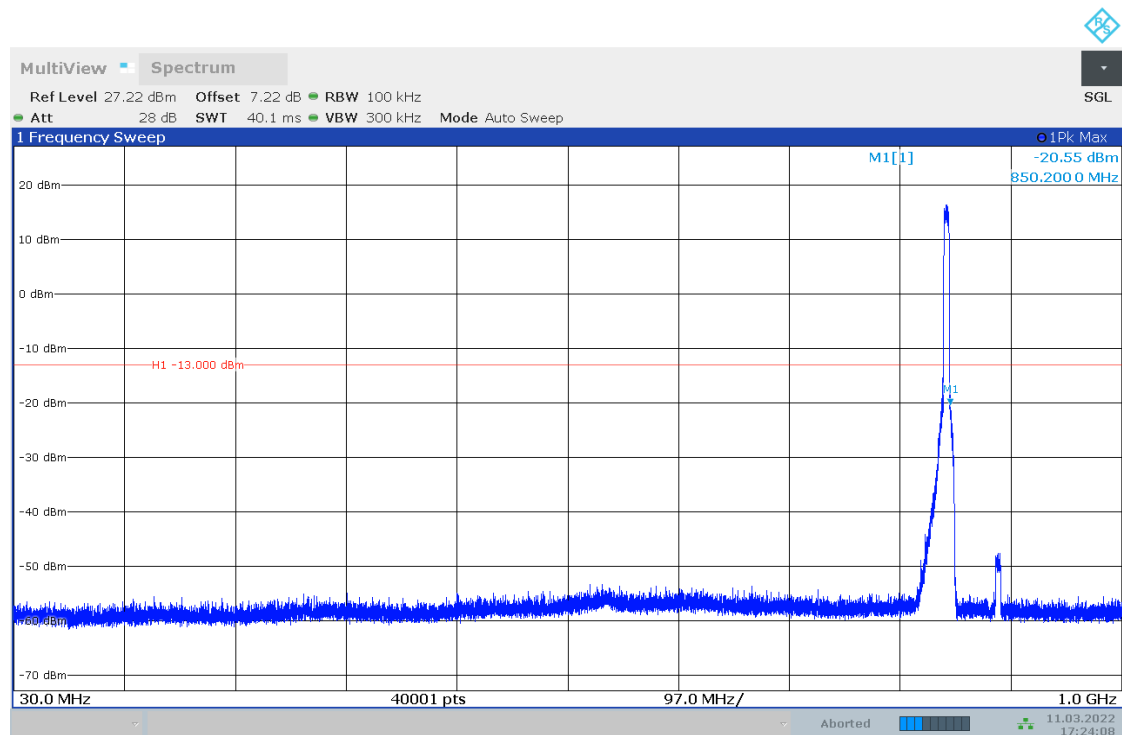



17:24:09 11.03.2022

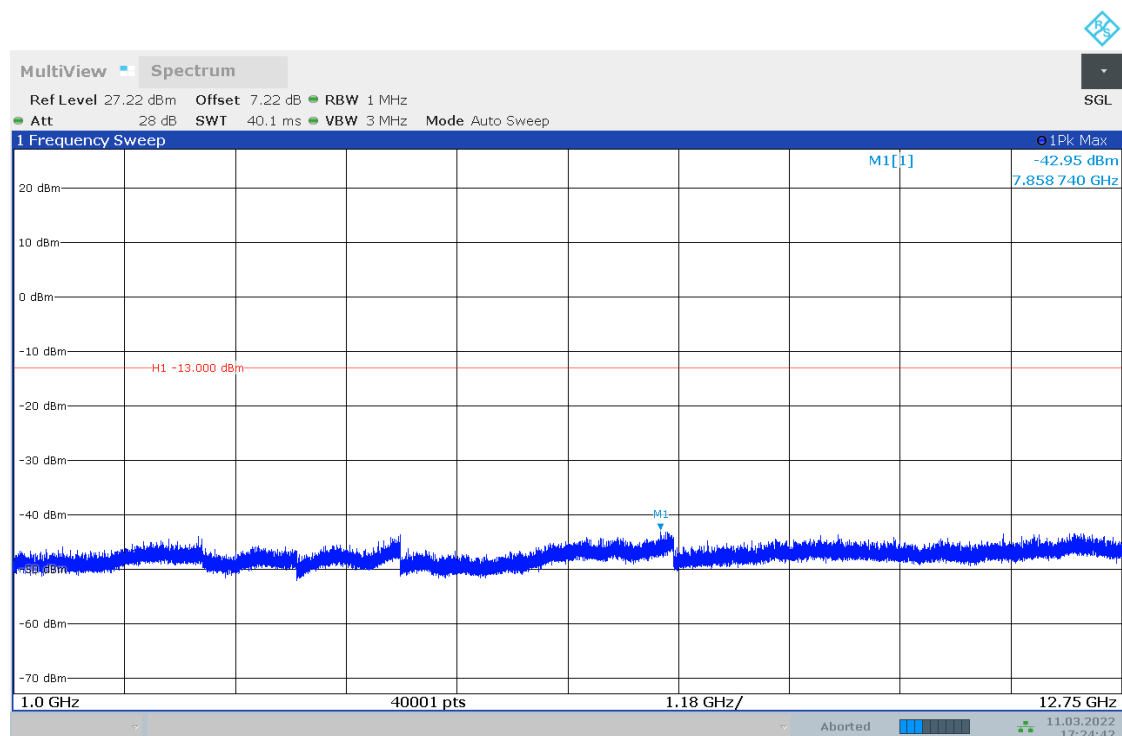


17:24:43 11.03.2022

6.2.46 TM2_10MHz_LCH_RB1#0

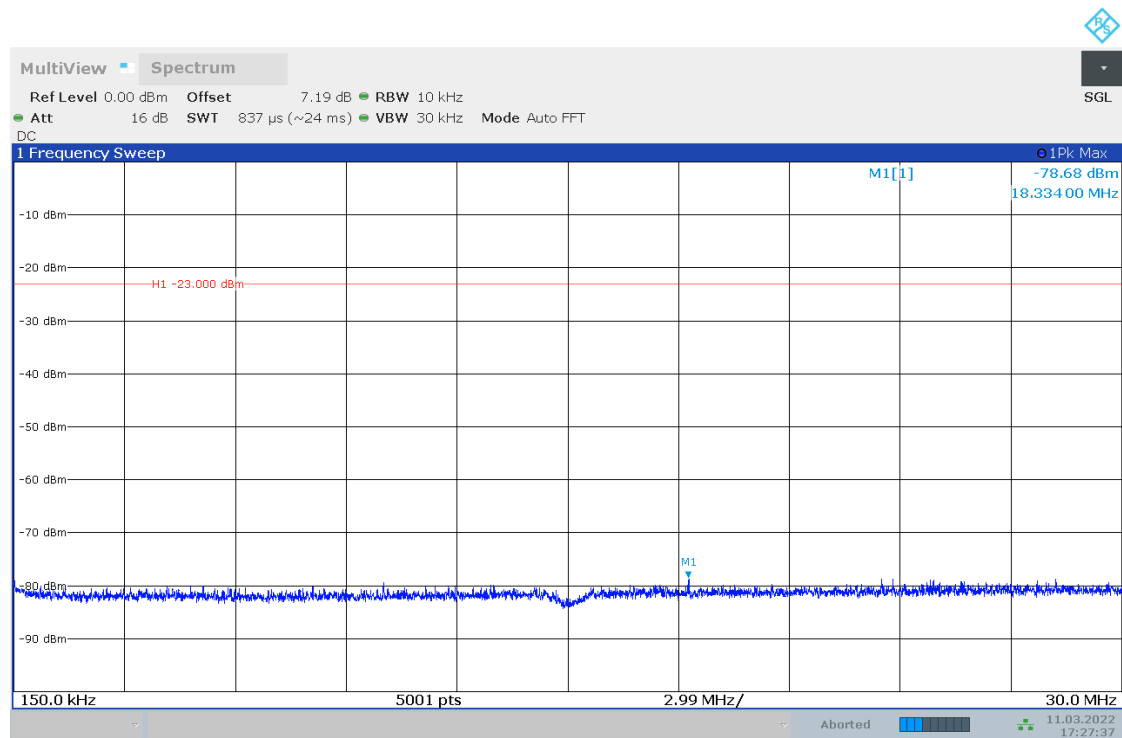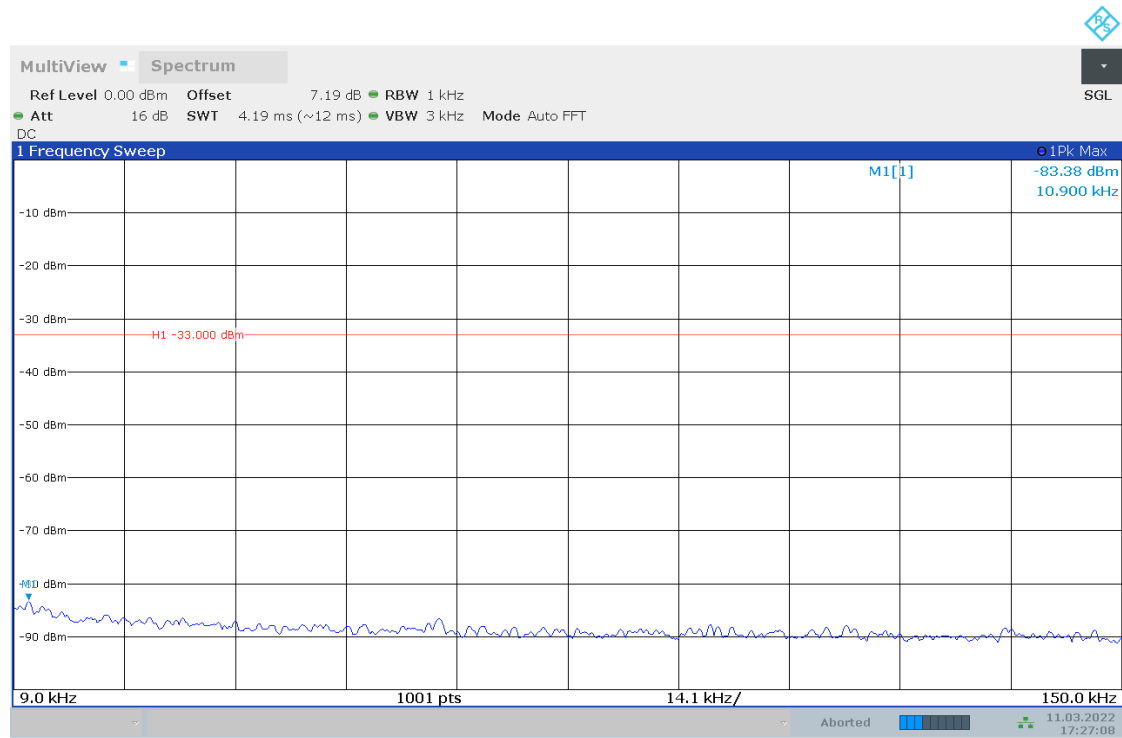


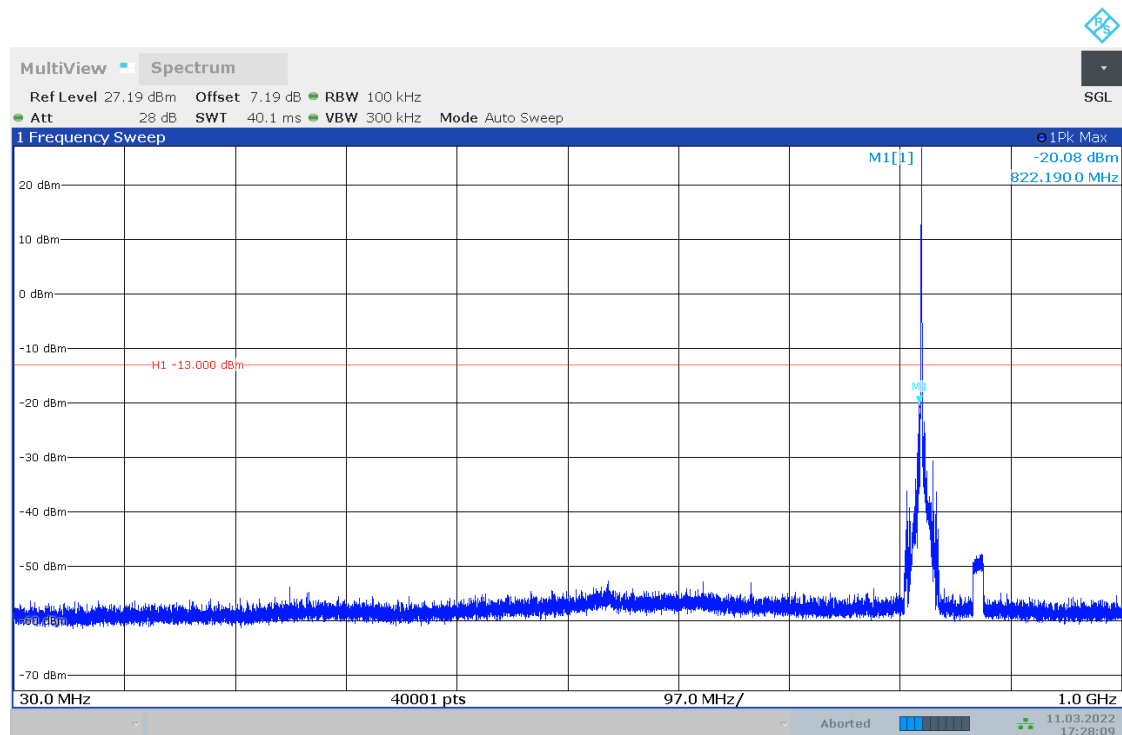



17:28:09 11.03.2022

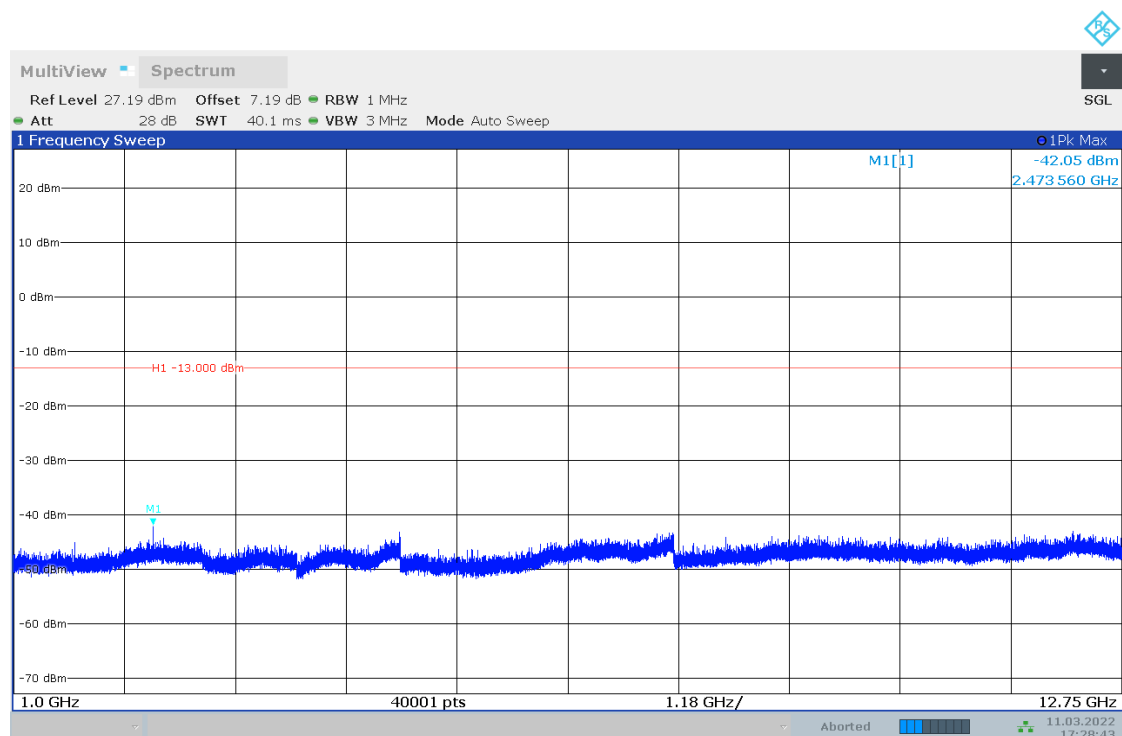


17:28:43 11.03.2022

6.2.47 TM2_10MHz_LCH_RB1#49

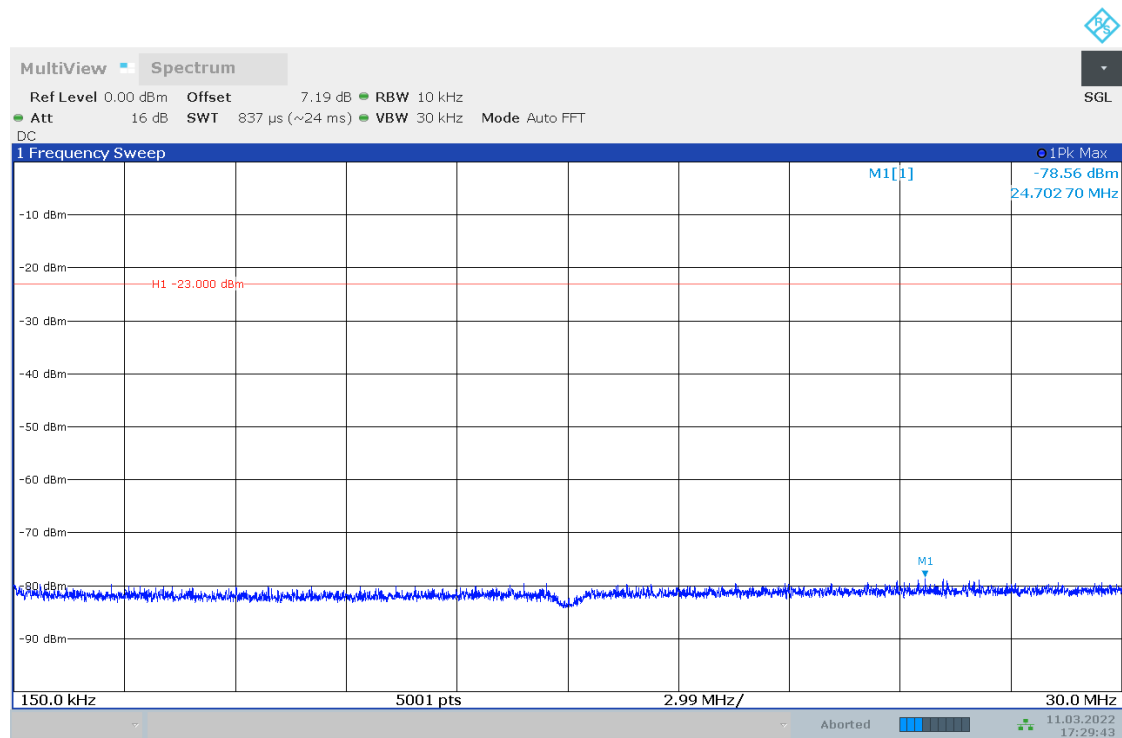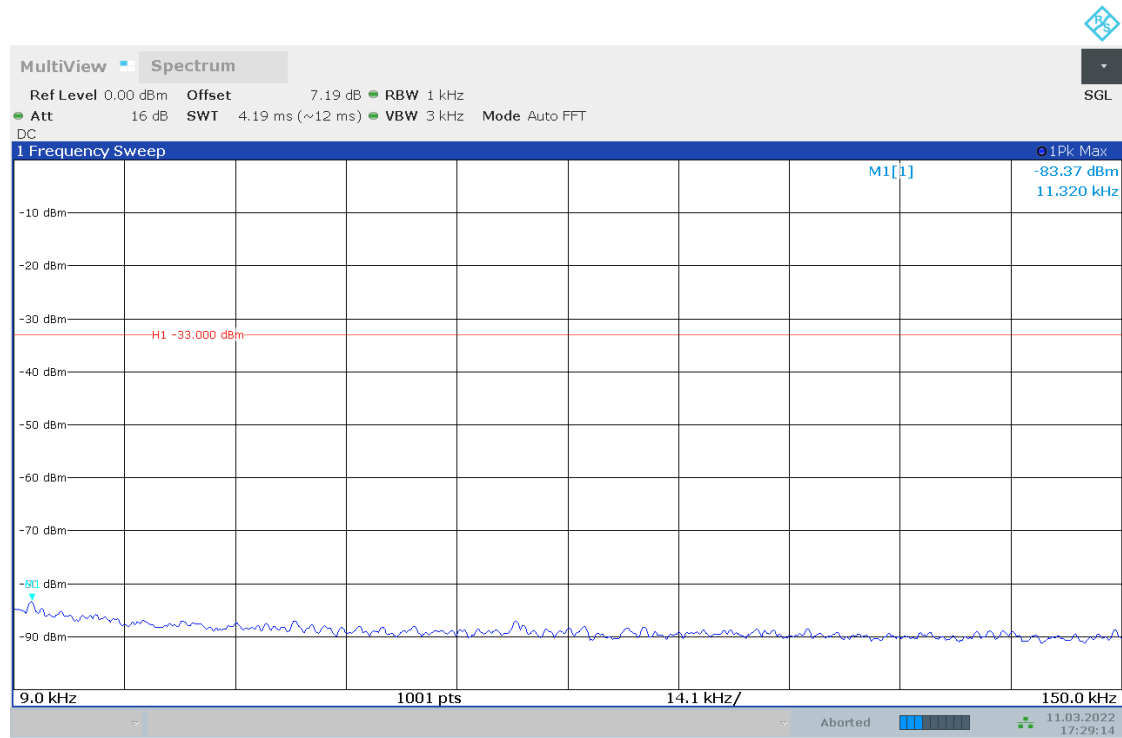


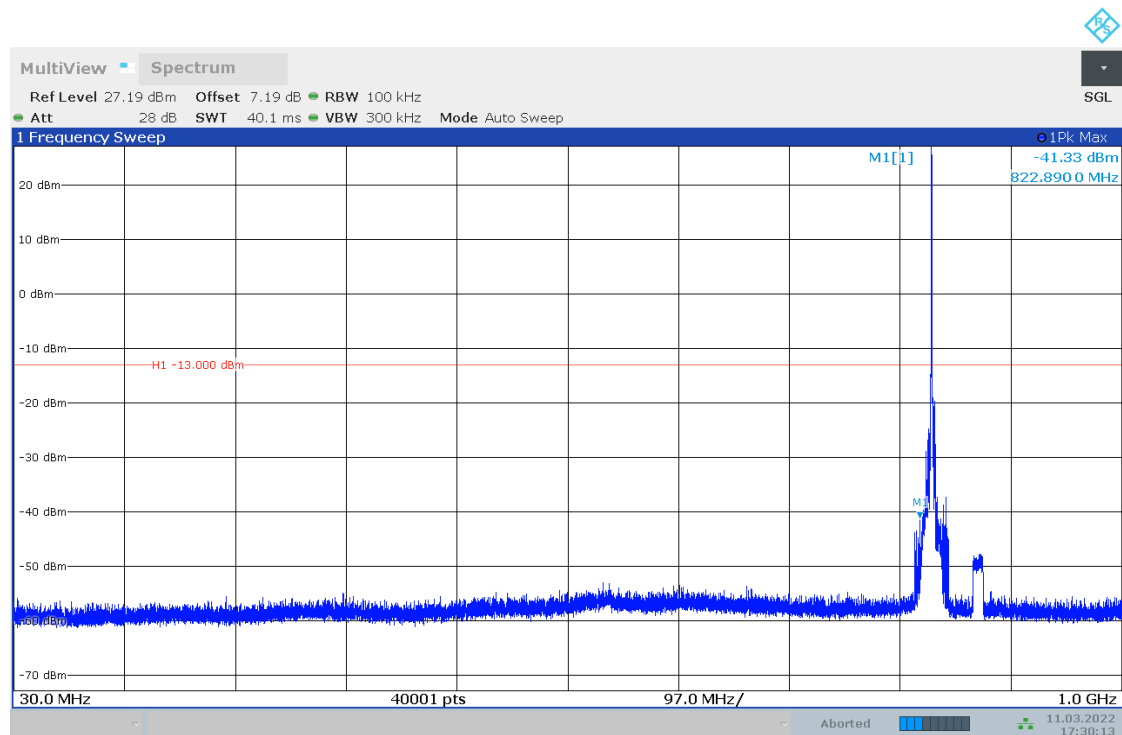




17:30:13 11.03.2022

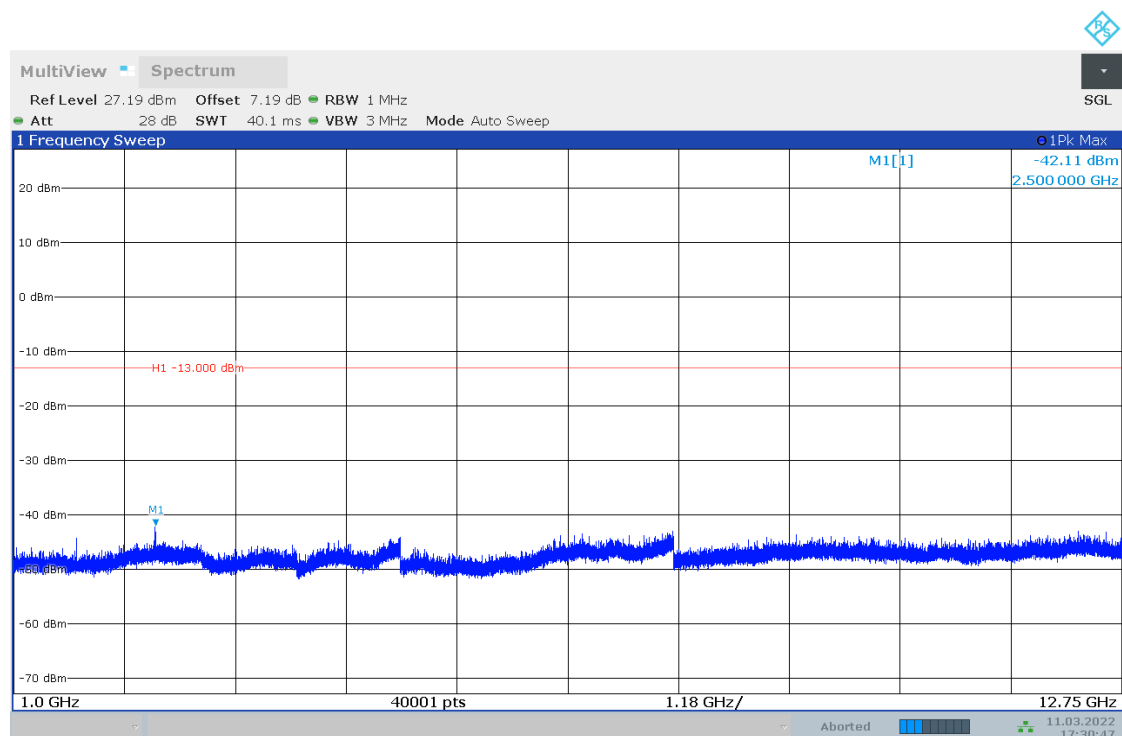



17:30:47 11.03.2022


6.2.48 TM2_10MHz_LCH_RB50#0

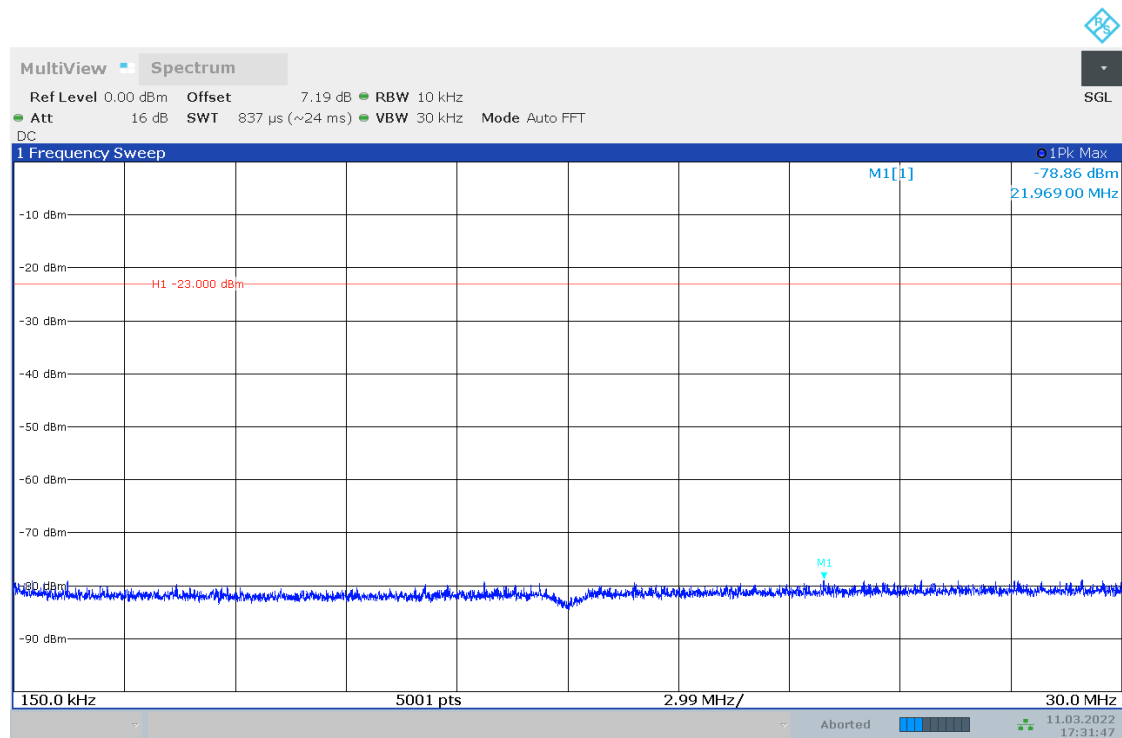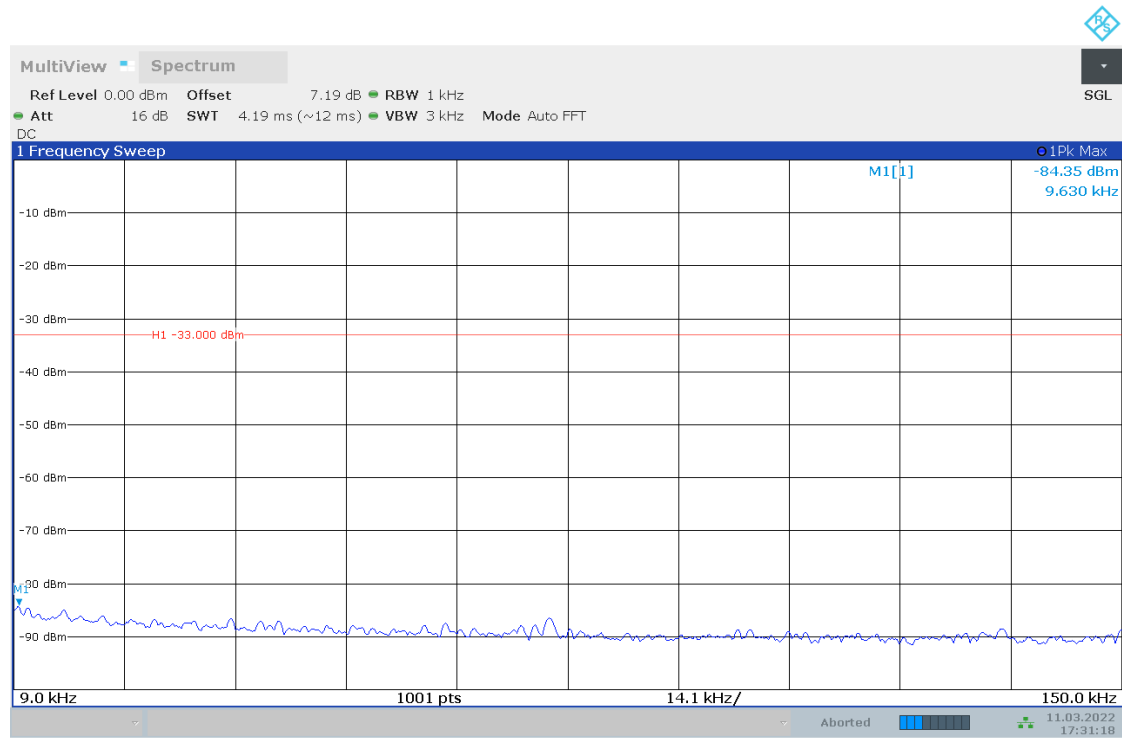

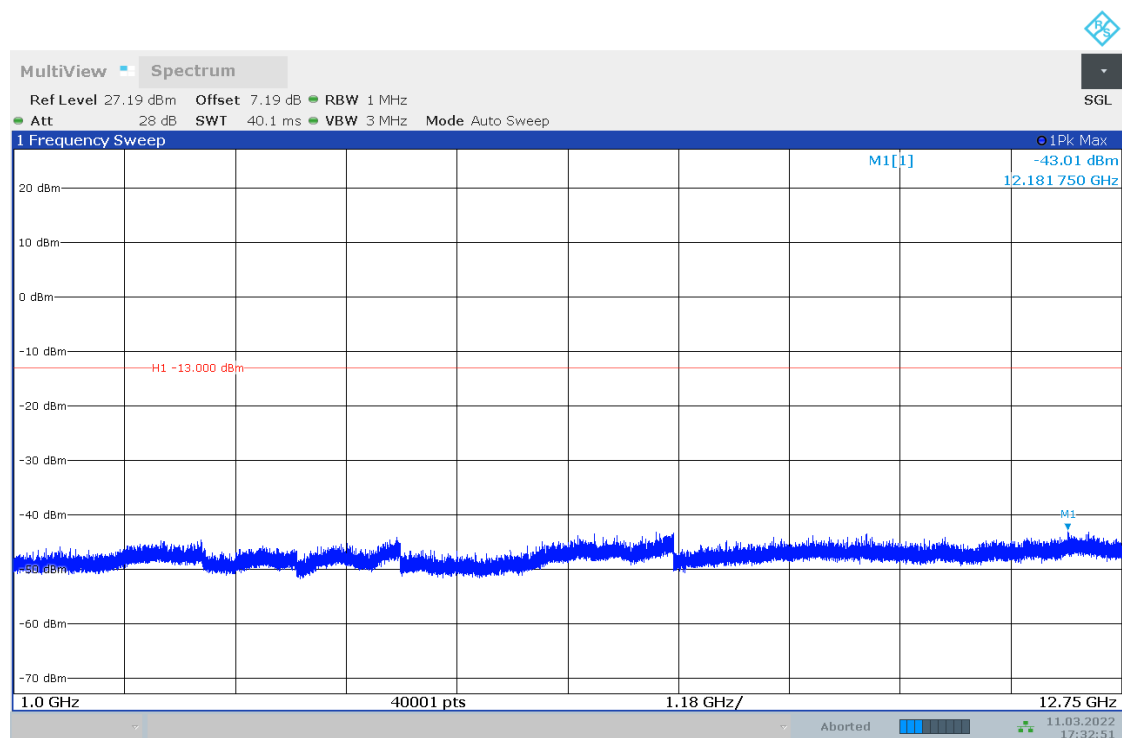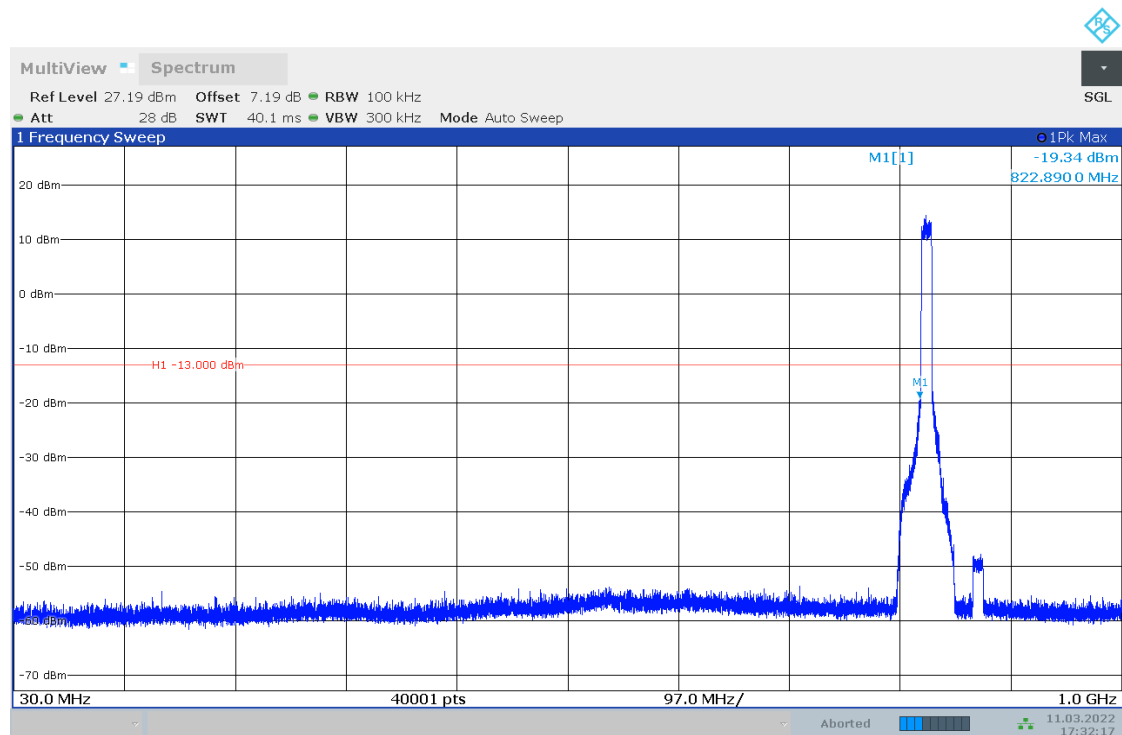


6.2.49 TM2_10MHz_MCH_RB1#0

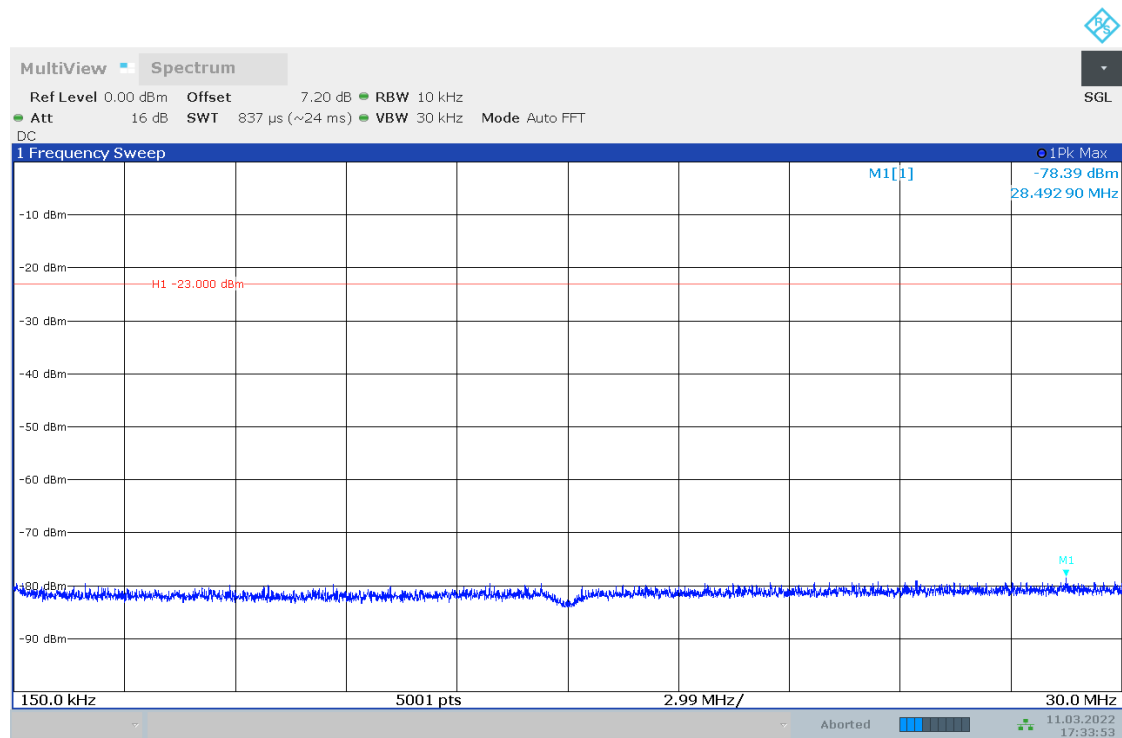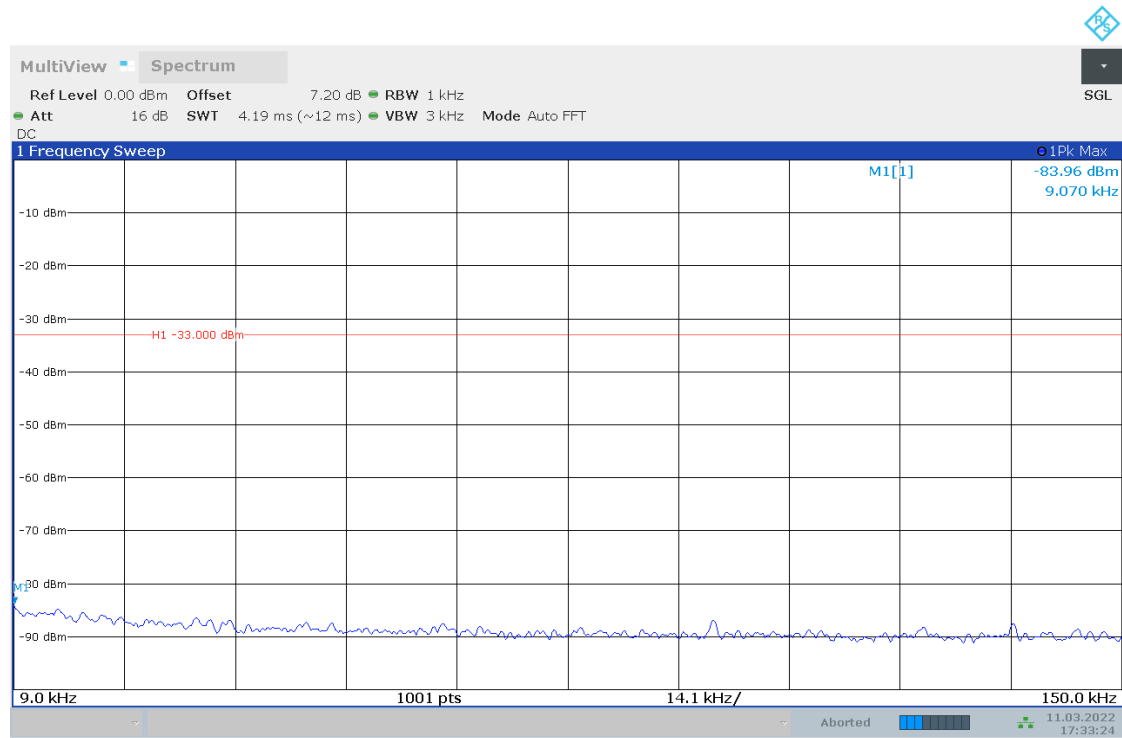

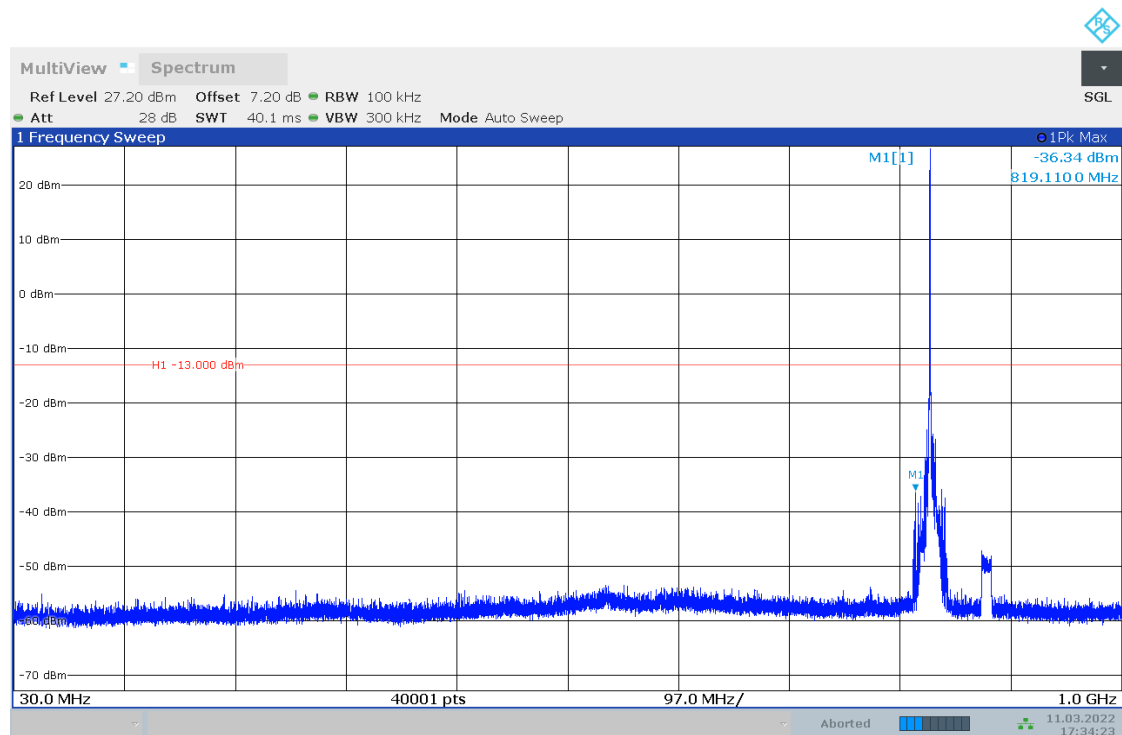


17:34:24 11.03.2022

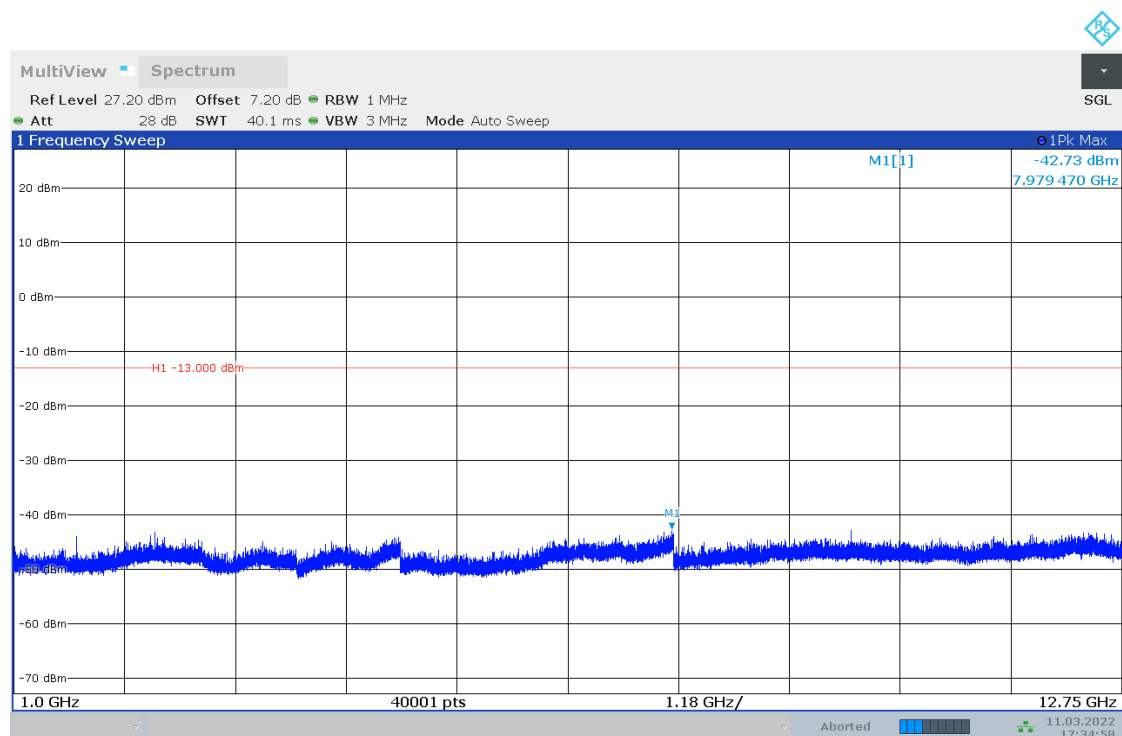


17:34:58 11.03.2022


6.2.50 TM2_10MHz_MCH_RB1#49

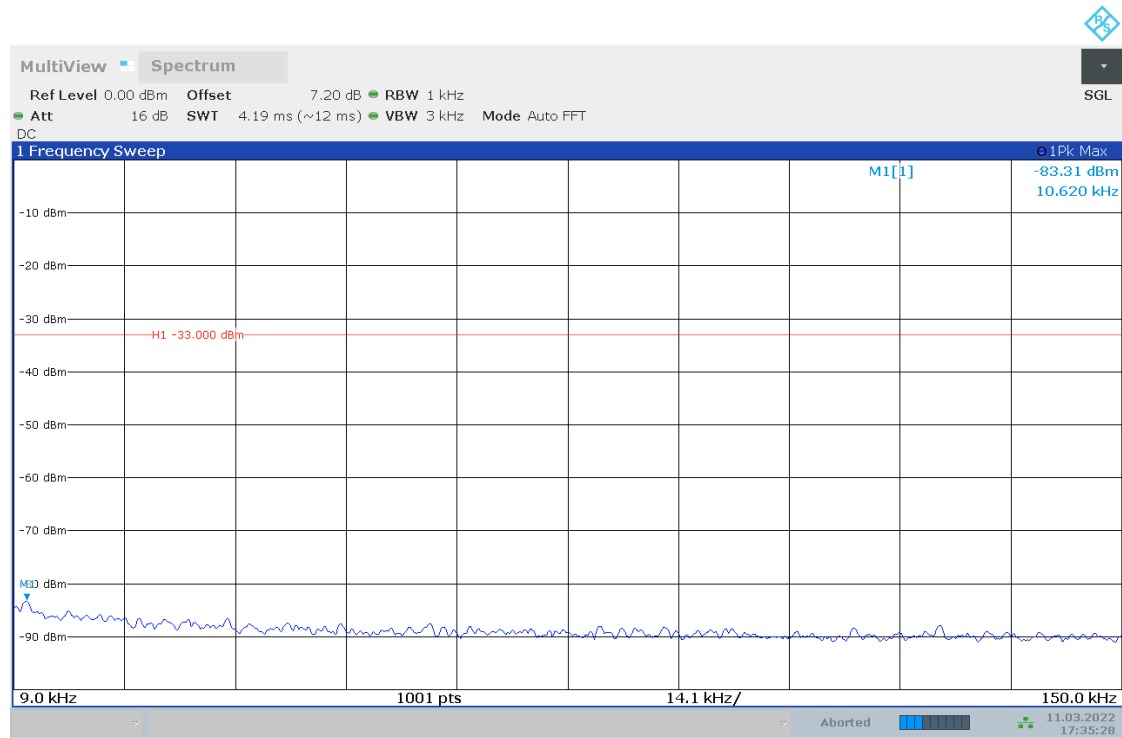


17:35:29 11.03.2022

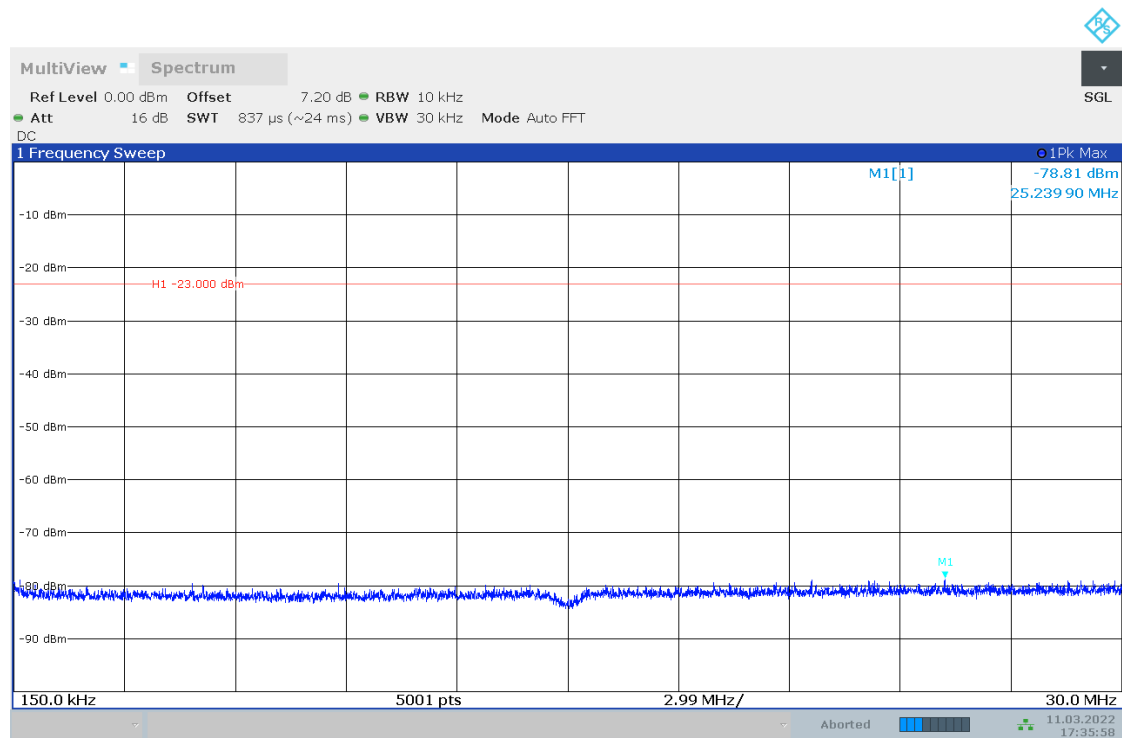

17:35:58 11.03.2022

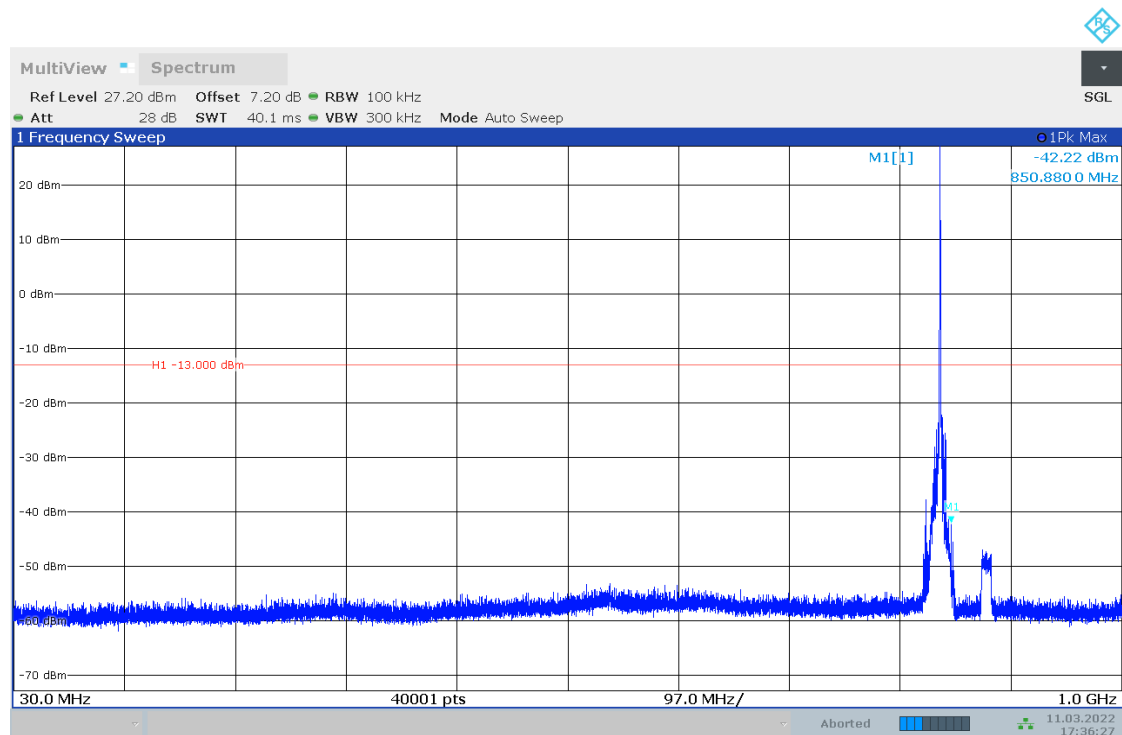


17:36:28 11.03.2022

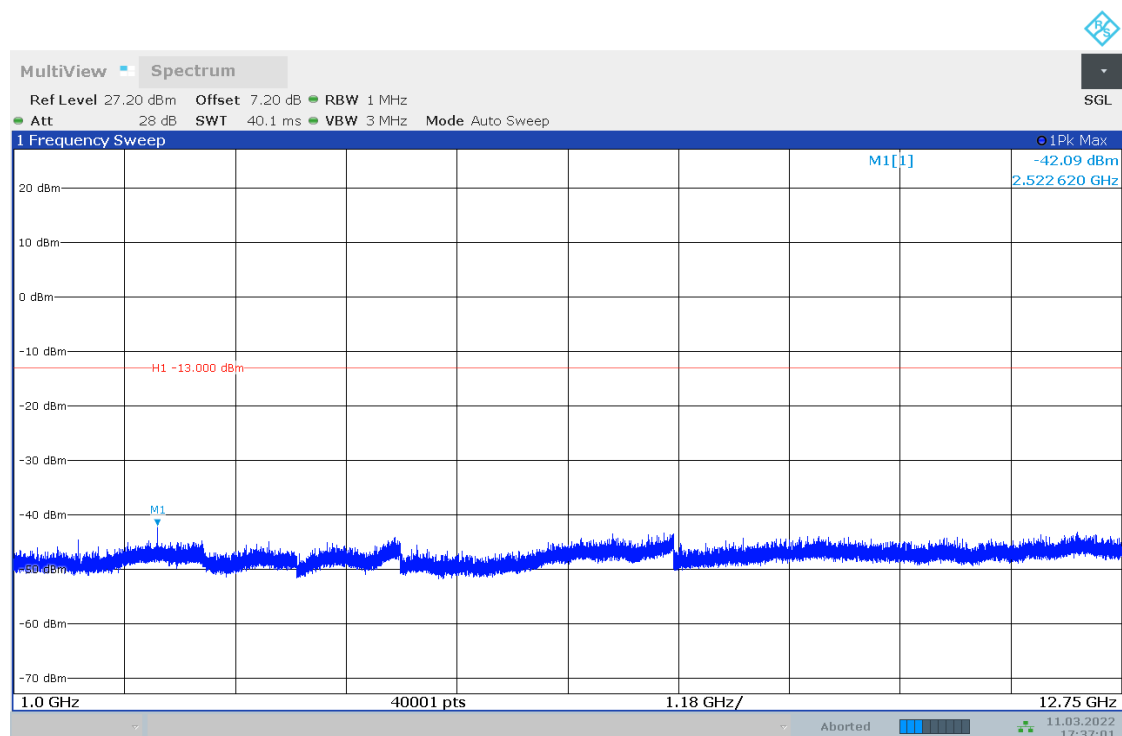


17:37:02 11.03.2022


6.2.51 TM2_10MHz_MCH_RB50#0

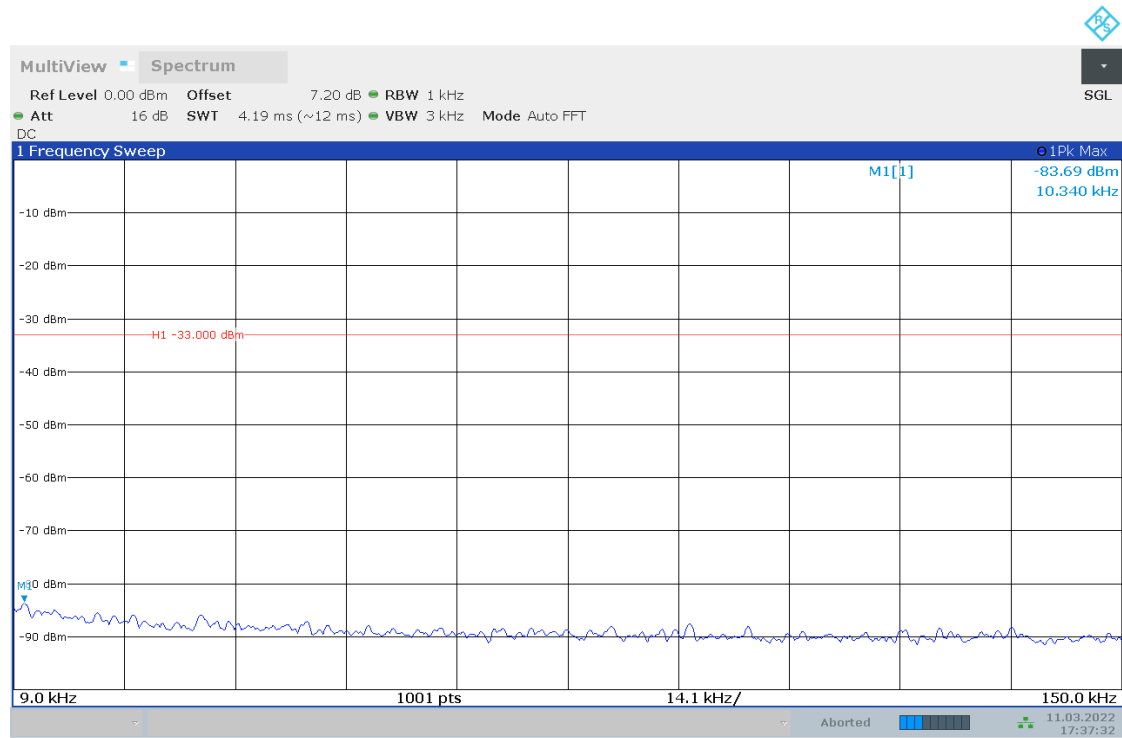


17:37:32 11.03.2022

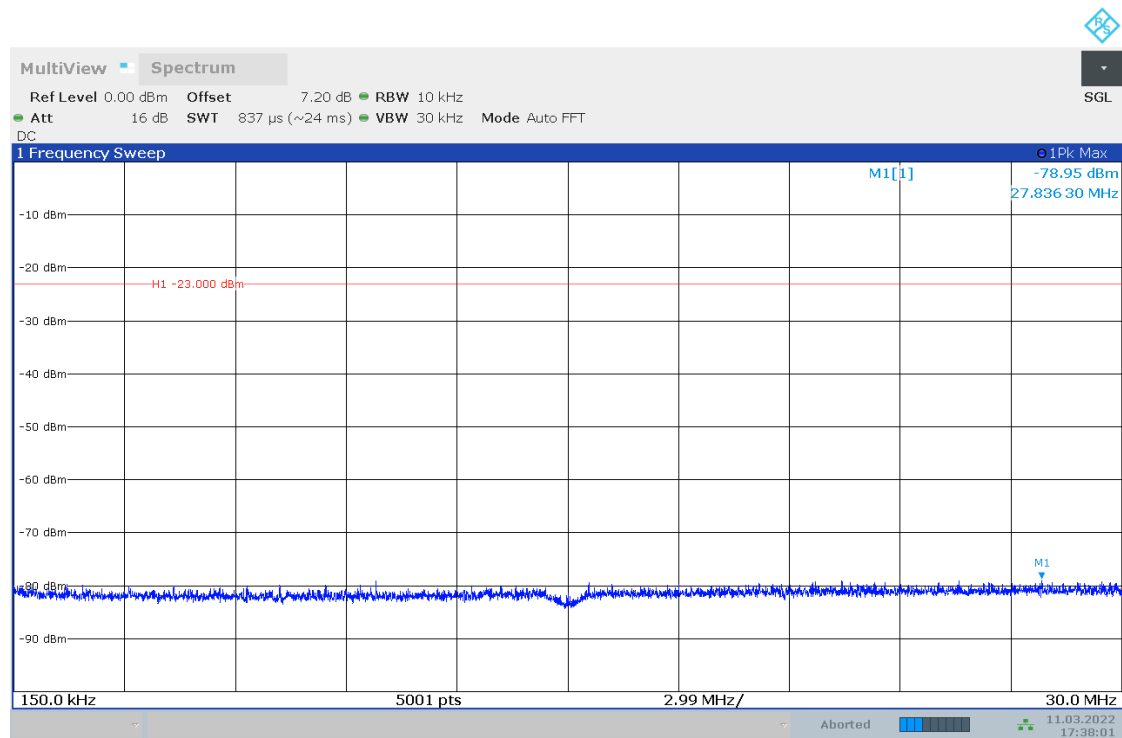

17:38:02 11.03.2022

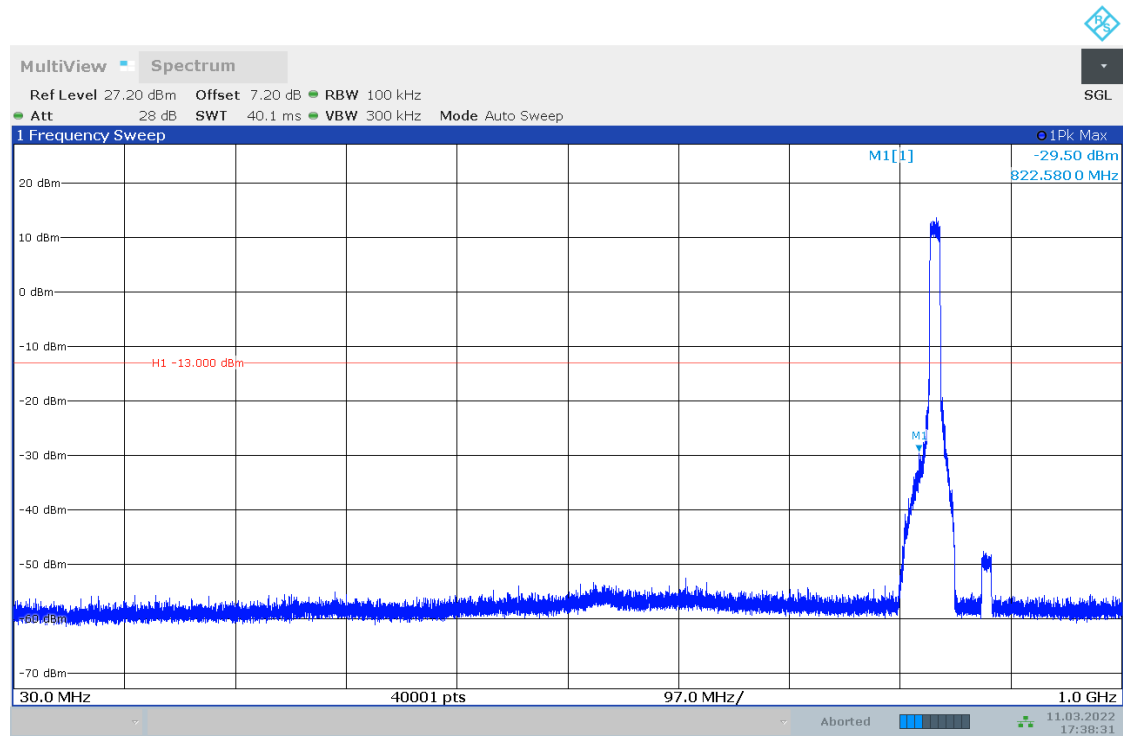



17:38:31 11.03.2022

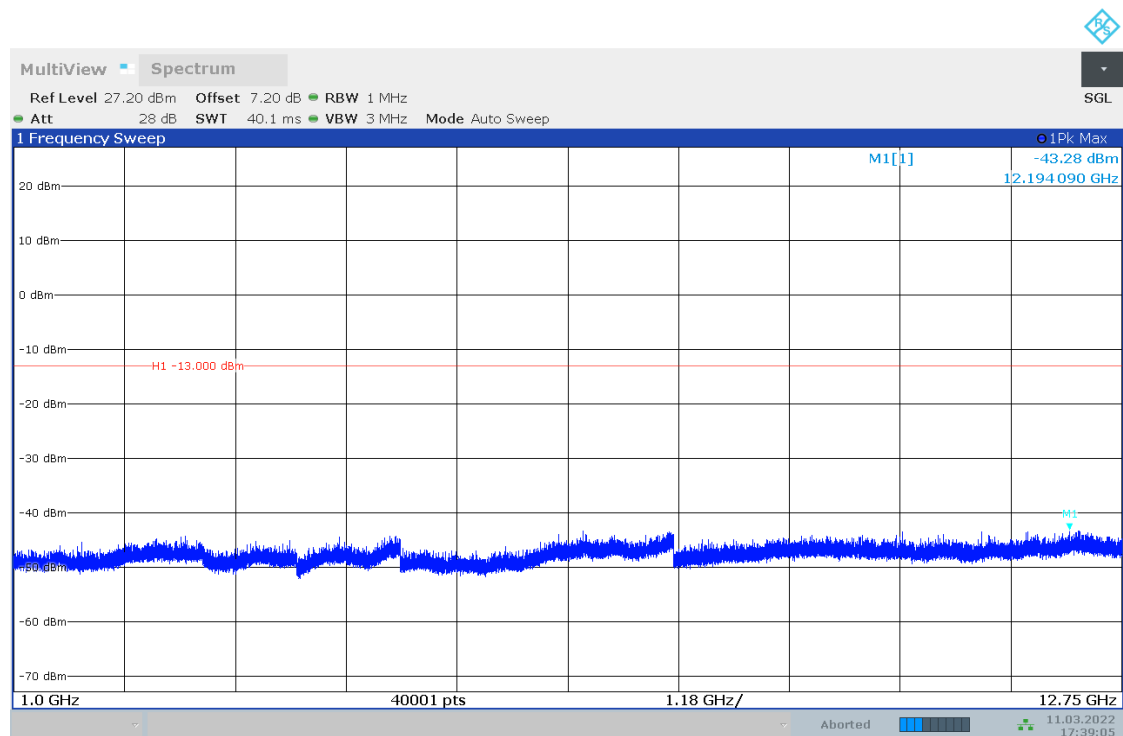


17:39:05 11.03.2022

6.2.52 TM2_10MHz_HCH_RB1#0

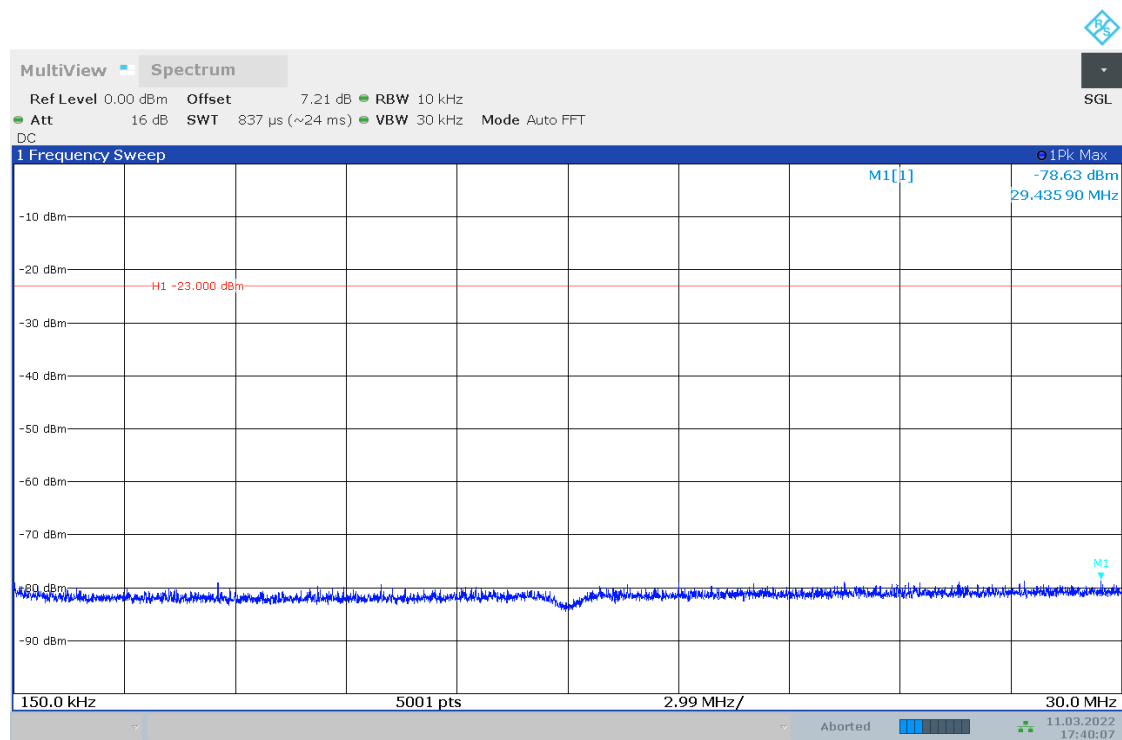

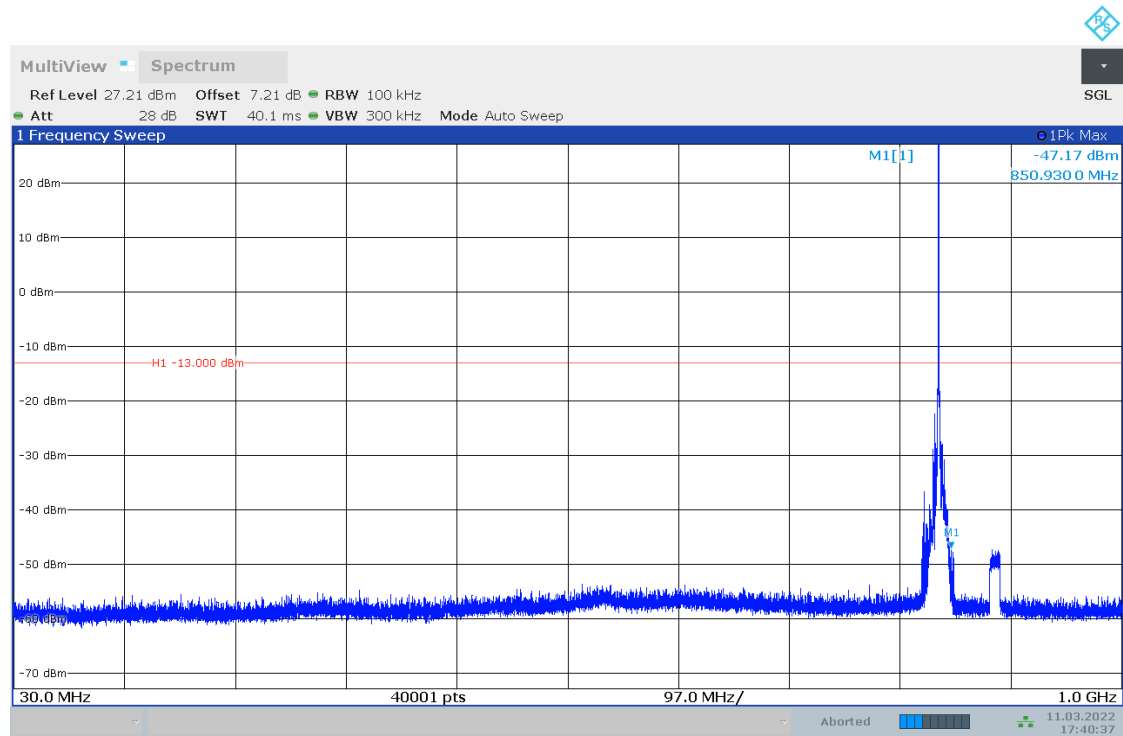


17:40:38 11.03.2022

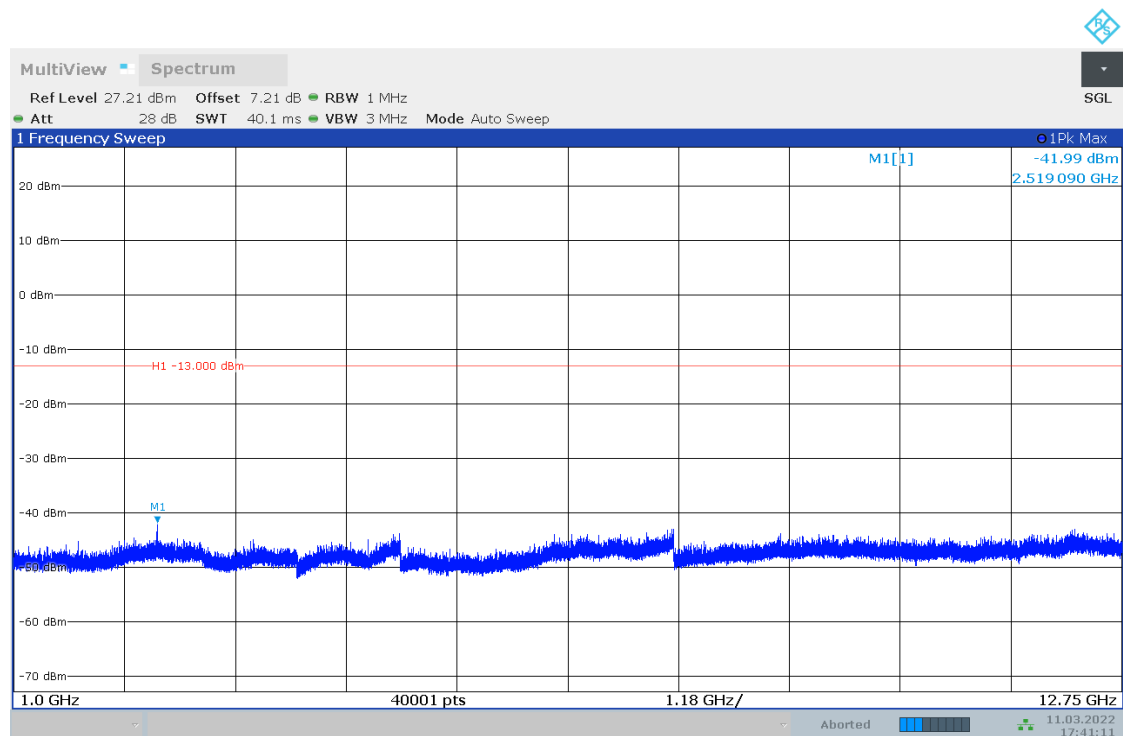


17:41:12 11.03.2022


6.2.53 TM2_10MHz_HCH_RB1#49

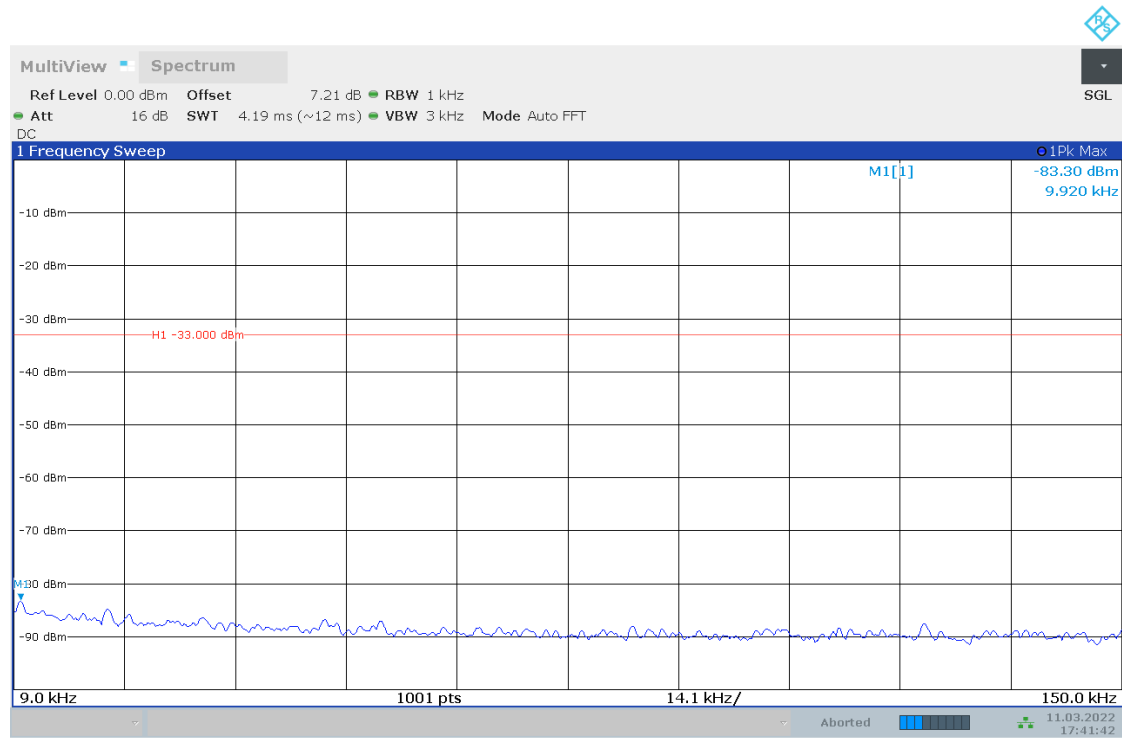


17:41:43 11.03.2022

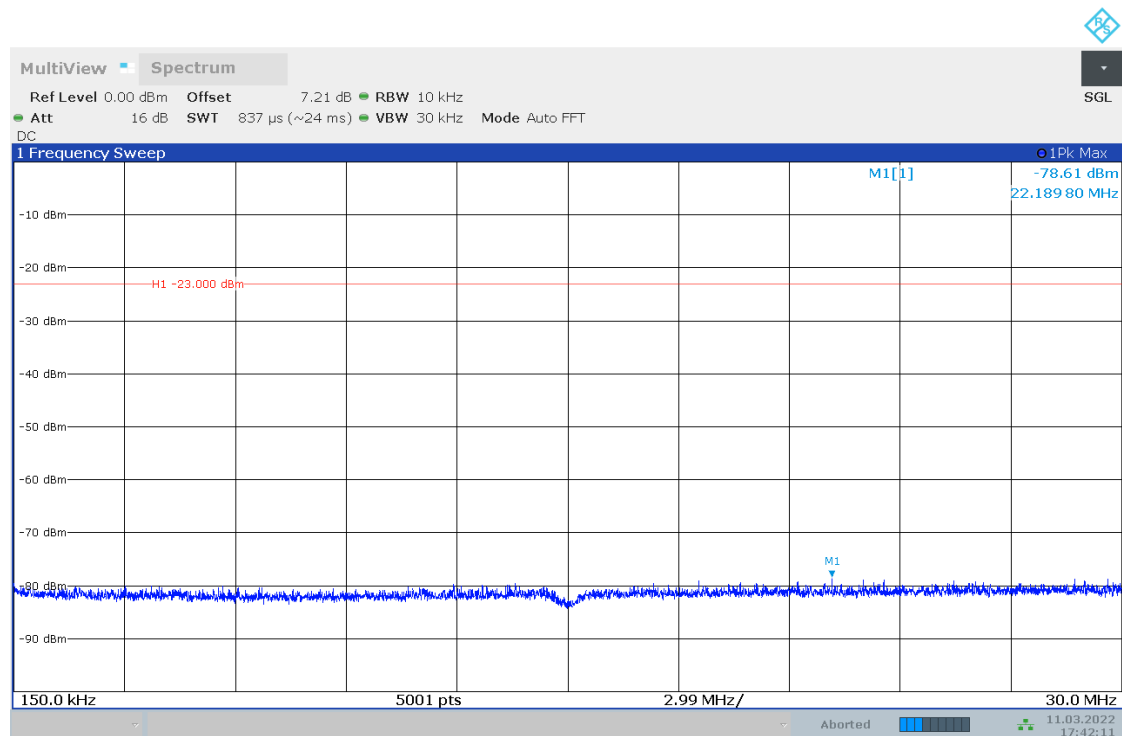

17:42:12 11.03.2022

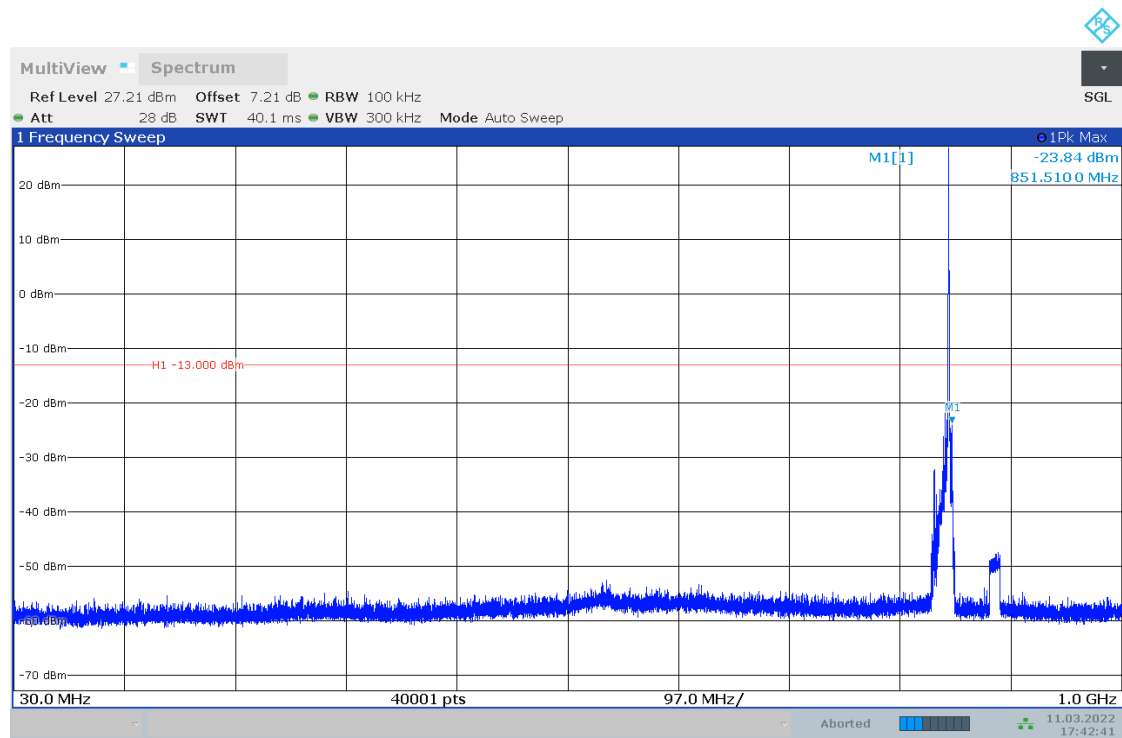


17:42:42 11.03.2022

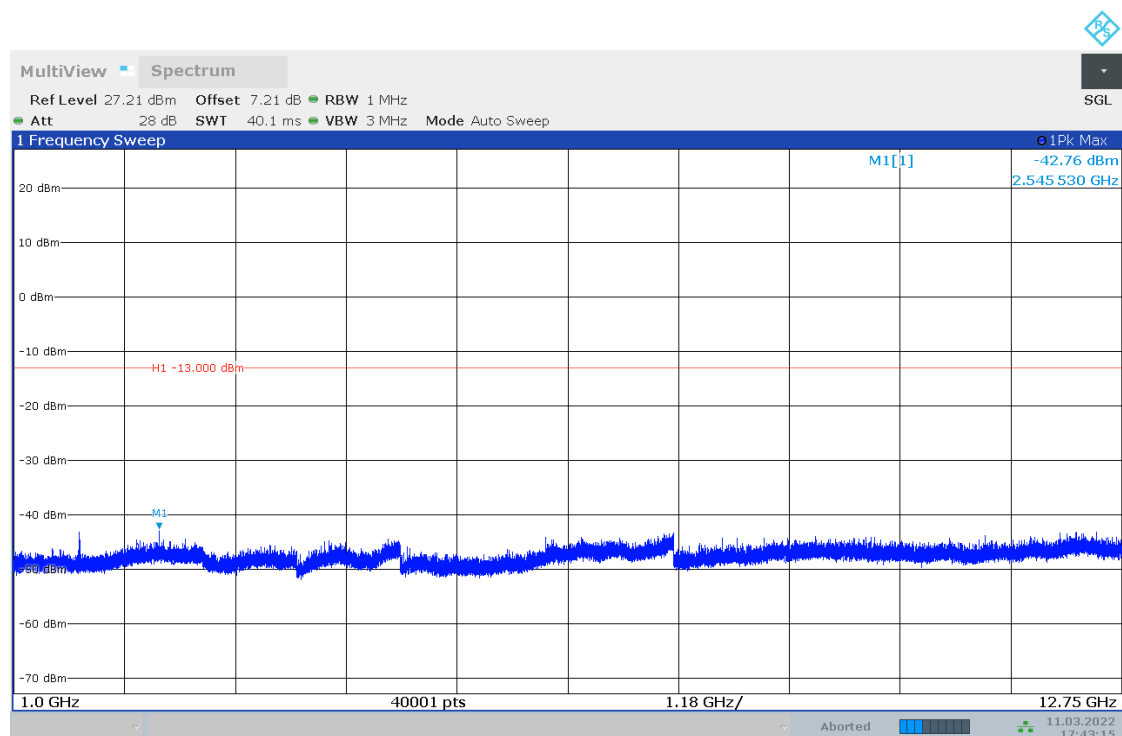


17:43:16 11.03.2022


6.2.54 TM2_10MHz_HCH_RB50#0

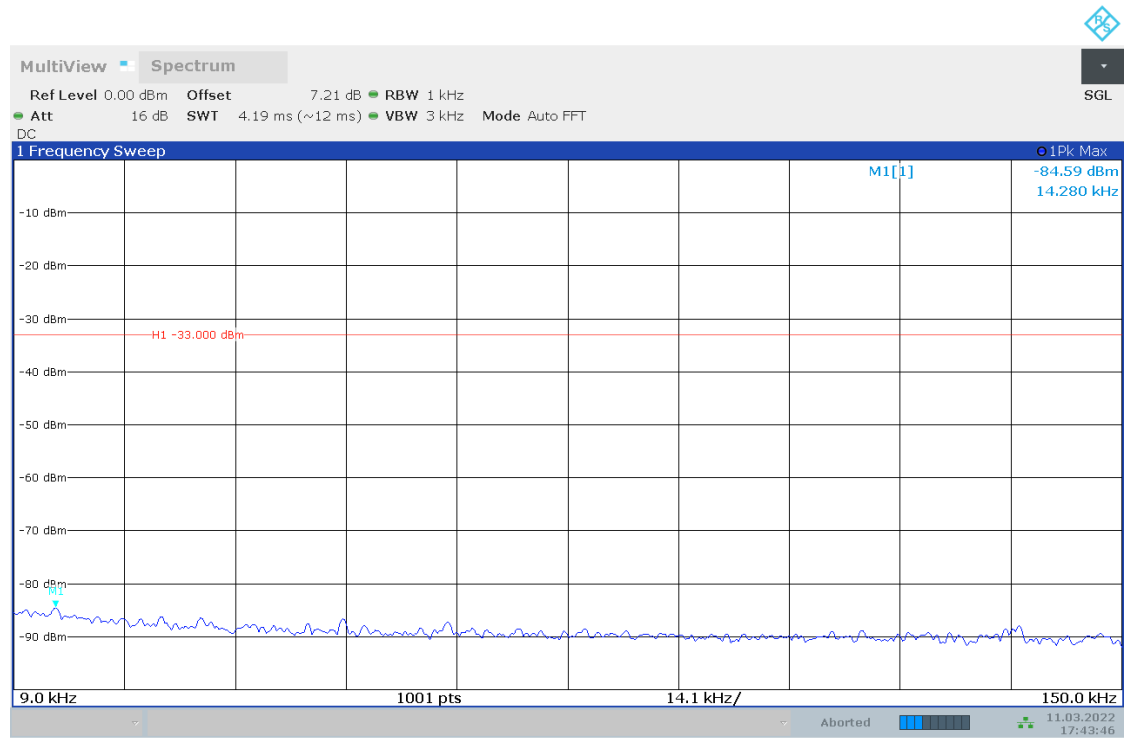


17:43:47 11.03.2022

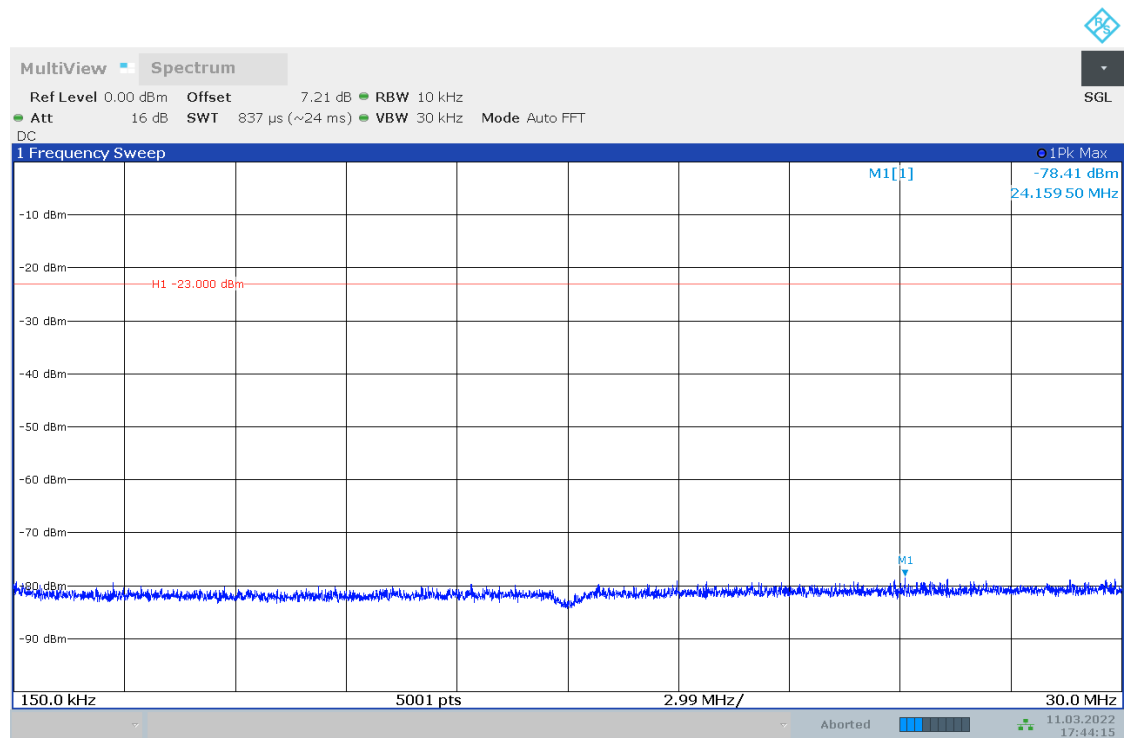

17:44:16 11.03.2022

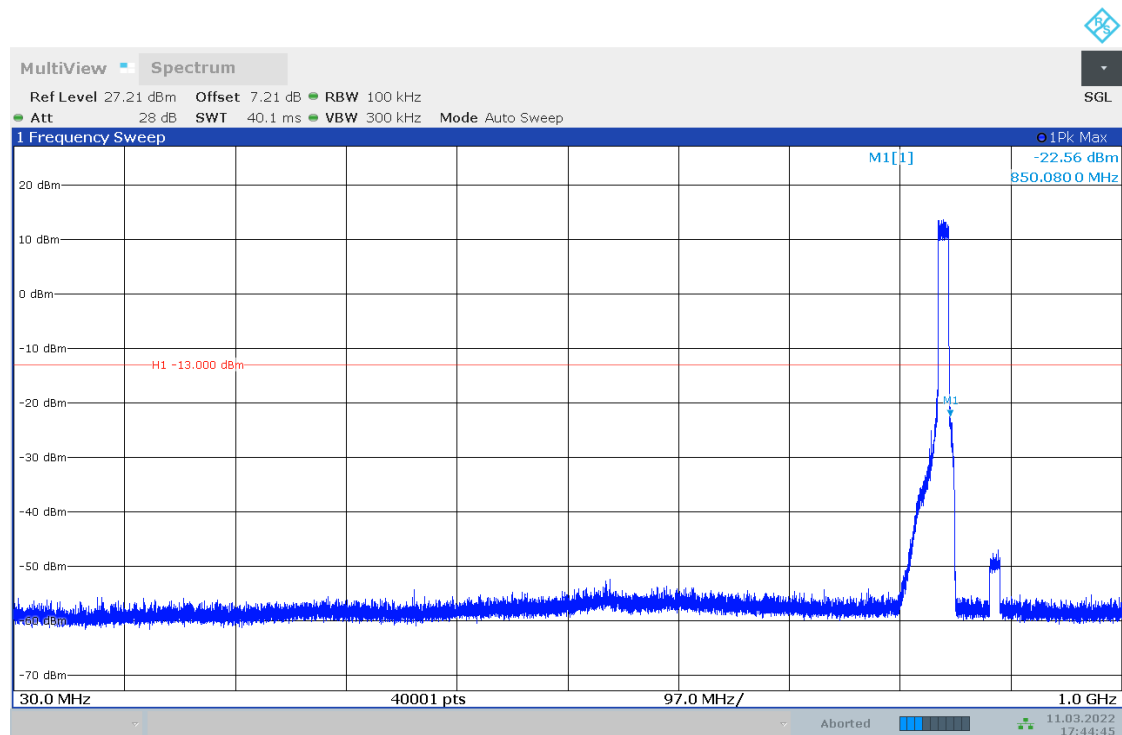

17:44:46 11.03.2022

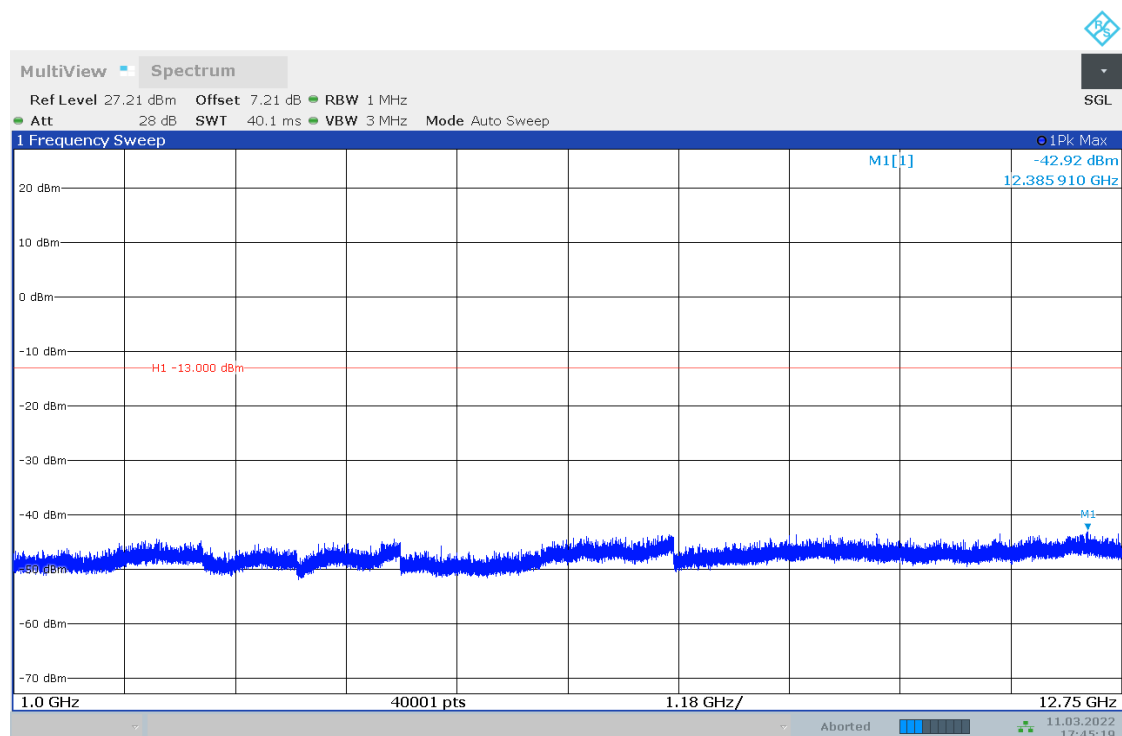

17:45:20 11.03.2022

7. Appendix_G: Frequency Stability

7.1 Test Results

7.1.1 Frequency Error vs. Voltage

Frequency Error vs. Voltage								
Test Mode	Test Bandwidth [MHz]	Test Channel	Modulation	Test Temp.	Test Volt.	Freq. Error [Hz]	Freq. vs. rated [ppm]	Verdict
TM1	1.4	LCH	QPSK	TN	VH	-30.46	-0.04	PASS
			QPSK	TN	VN	-9.4	-0.01	PASS
			QPSK	TN	VL	-3.66	0	PASS
		MCH	QPSK	TN	VH	8.12	0.01	PASS
			QPSK	TN	VN	17.21	0.02	PASS
			QPSK	TN	VL	16.9	0.02	PASS
		HCH	QPSK	TN	VH	6.73	0.01	PASS
			QPSK	TN	VN	3.51	0	PASS
			QPSK	TN	VL	-6.45	-0.01	PASS
	5	LCH	QPSK	TN	VH	2.87	0	PASS
			QPSK	TN	VN	-3.76	0	PASS
			QPSK	TN	VL	1.13	0	PASS
		MCH	QPSK	TN	VH	2.53	0	PASS
			QPSK	TN	VN	7.83	0.01	PASS
			QPSK	TN	VL	9.07	0.01	PASS
		HCH	QPSK	TN	VH	0.75	0	PASS
			QPSK	TN	VN	7.54	0.01	PASS
			QPSK	TN	VL	-9.11	-0.01	PASS
	10	LCH	QPSK	TN	VH	1.67	0	PASS
			QPSK	TN	VN	-1.17	0	PASS
			QPSK	TN	VL	-1.22	0	PASS
		MCH	QPSK	TN	VH	4.02	0	PASS
			QPSK	TN	VN	0.05	0	PASS
			QPSK	TN	VL	1.55	0	PASS
		HCH	QPSK	TN	VH	4.35	0.01	PASS
			QPSK	TN	VN	2.25	0	PASS
			QPSK	TN	VL	-2.44	0	PASS

Frequency Error vs. Voltage								
Test Mode	Test Bandwidth [MHz]	Test Channel	Modulation	Test Temp.	Test Volt.	Freq. Error [Hz]	Freq. vs. rated [ppm]	Verdict
TM2	1.4	LCH	16QAM	TN	VH	17.57	0.02	PASS
			16QAM	TN	VN	-3.21	0	PASS
			16QAM	TN	VL	-1.77	0	PASS
		MCH	16QAM	TN	VH	7.82	0.01	PASS
			16QAM	TN	VN	5.47	0.01	PASS
			16QAM	TN	VL	8.93	0.01	PASS
		HCH	16QAM	TN	VH	-23.71	-0.03	PASS
			16QAM	TN	VN	-17.23	-0.02	PASS
			16QAM	TN	VL	-11.79	-0.01	PASS
	5	LCH	16QAM	TN	VH	-1.28	0	PASS
			16QAM	TN	VN	0.69	0	PASS
			16QAM	TN	VL	-1.92	0	PASS
		MCH	16QAM	TN	VH	-6.16	-0.01	PASS
			16QAM	TN	VN	-1.04	0	PASS
			16QAM	TN	VL	-0.84	0	PASS
		HCH	16QAM	TN	VH	1.49	0	PASS
			16QAM	TN	VN	-2.43	0	PASS
			16QAM	TN	VL	1.89	0	PASS
	10	LCH	16QAM	TN	VH	4.23	0.01	PASS
			16QAM	TN	VN	-3.42	0	PASS
			16QAM	TN	VL	-3.45	0	PASS
		MCH	16QAM	TN	VH	-1.53	0	PASS
			16QAM	TN	VN	-2.26	0	PASS
			16QAM	TN	VL	-3.41	0	PASS
		HCH	16QAM	TN	VH	5.54	0.01	PASS
			16QAM	TN	VN	-2.07	0	PASS
			16QAM	TN	VL	-4.29	-0.01	PASS

7.1.2 Frequency Error vs. Temperature

Frequency Error vs. Temperature								
Test Mode	Test Bandwidth [MHz]	Test Channel	Modulation	Test Volt.	Test Temp.	Freq. Error [Hz]	Freq. vs. rated [ppm]	Verdict
TM1	1.4	LCH	QPSK	VN	-30	-10.66	-0.01	PASS
			QPSK	VN	-20	-11.81	-0.01	PASS
			QPSK	VN	-10	1.18	0.00	PASS
			QPSK	VN	0	-12.97	-0.02	PASS
			QPSK	VN	10	2.74	0	PASS
			QPSK	VN	20	-0.45	0	PASS
			QPSK	VN	30	2.03	0	PASS
			QPSK	VN	40	-23.45	-0.03	PASS
			QPSK	VN	50	12.84	0.02	PASS
		MCH	QPSK	VN	-30	-24.78	-0.03	PASS
			QPSK	VN	-20	-20.97	-0.03	PASS
			QPSK	VN	-10	-4.49	-0.01	PASS
			QPSK	VN	0	-13.09	-0.02	PASS
			QPSK	VN	10	6.08	0.01	PASS
			QPSK	VN	20	-5.22	-0.01	PASS
			QPSK	VN	30	0.38	0	PASS
			QPSK	VN	40	-7.07	-0.01	PASS
			QPSK	VN	50	-0.83	0	PASS
		HCH	QPSK	VN	-30	-23.11	-0.03	PASS
			QPSK	VN	-20	-10.98	-0.01	PASS
			QPSK	VN	-10	-3.76	0	PASS
			QPSK	VN	0	-3.66	0	PASS
			QPSK	VN	10	3.46	0	PASS
			QPSK	VN	20	2.42	0	PASS
			QPSK	VN	30	3.64	0	PASS
			QPSK	VN	40	2.61	0	PASS
			QPSK	VN	50	-8.87	-0.01	PASS

Frequency Error vs. Temperature								
Test Mode	Test Bandwidth [MHz]	Test Channel	Modulation	Test Volt.	Test Temp.	Freq. Error [Hz]	Freq. vs. rated [ppm]	Verdict
TM1	5	LCH	QPSK	VN	-30	1.33	0	PASS
			QPSK	VN	-20	6.06	0.01	PASS
			QPSK	VN	-10	8.8	0.01	PASS
			QPSK	VN	0	-3.31	0	PASS
			QPSK	VN	10	2.05	0	PASS
			QPSK	VN	20	4.06	0	PASS
			QPSK	VN	30	7.72	0.01	PASS
			QPSK	VN	40	4.16	0.01	PASS
			QPSK	VN	50	-1.94	0	PASS
		MCH	QPSK	VN	-30	0.25	0	PASS
			QPSK	VN	-20	3.01	0	PASS
			QPSK	VN	-10	1.62	0	PASS
			QPSK	VN	0	7.95	0.01	PASS
			QPSK	VN	10	-4.19	-0.01	PASS
			QPSK	VN	20	-1.64	0	PASS
			QPSK	VN	30	-11.41	-0.01	PASS
			QPSK	VN	40	-2.92	0	PASS
			QPSK	VN	50	-0.38	0	PASS
		HCH	QPSK	VN	-30	8.03	0.01	PASS
			QPSK	VN	-20	8.42	0.01	PASS
			QPSK	VN	-10	9.16	0.01	PASS
			QPSK	VN	0	12.67	0.01	PASS
			QPSK	VN	10	-4.1	0	PASS
			QPSK	VN	20	-1.15	0	PASS
			QPSK	VN	30	3.79	0	PASS
			QPSK	VN	40	6.58	0.01	PASS
			QPSK	VN	50	10.86	0.01	PASS

Frequency Error vs. Temperature								
Test Mode	Test Bandwidth [MHz]	Test Channel	Modulation	Test Volt.	Test Temp.	Freq. Error [Hz]	Freq. vs. rated [ppm]	Verdict
TM1	10	LCH	QPSK	VN	-30	1.34	0	PASS
			QPSK	VN	-20	-2.9	0	PASS
			QPSK	VN	-10	0.63	0	PASS
			QPSK	VN	0	-0.04	0	PASS
			QPSK	VN	10	-1.02	0	PASS
			QPSK	VN	20	2.26	0	PASS
			QPSK	VN	30	-1.51	0	PASS
			QPSK	VN	40	-3.31	0	PASS
			QPSK	VN	50	3.28	0	PASS
		MCH	QPSK	VN	-30	-1.88	0	PASS
			QPSK	VN	-20	-0.12	0	PASS
			QPSK	VN	-10	-2.69	0	PASS
			QPSK	VN	0	0.94	0	PASS
			QPSK	VN	10	2.96	0	PASS
			QPSK	VN	20	-2.06	0	PASS
			QPSK	VN	30	-2.51	0	PASS
			QPSK	VN	40	-2.42	0	PASS
			QPSK	VN	50	-1.48	0	PASS
		HCH	QPSK	VN	-30	-0.72	0	PASS
			QPSK	VN	-20	0.81	0	PASS
			QPSK	VN	-10	1.7	0	PASS
			QPSK	VN	0	1.66	0	PASS
			QPSK	VN	10	-0.12	0	PASS
			QPSK	VN	20	0.18	0	PASS
			QPSK	VN	30	0.47	0	PASS
			QPSK	VN	40	-4.26	-0.01	PASS
			QPSK	VN	50	1.98	0	PASS

Frequency Error vs. Temperature								
Test Mode	Test Bandwidth [MHz]	Test Channel	Modulation	Test Volt.	Test Temp.	Freq. Error [Hz]	Freq. vs. rated [ppm]	Verdict
TM2	1.4	LCH	16QAM	VN	-30	-1.37	0	PASS
			16QAM	VN	-20	-13.68	-0.02	PASS
			16QAM	VN	-10	-17.7	-0.02	PASS
			16QAM	VN	0	-5.66	-0.01	PASS
			16QAM	VN	10	12.53	0.02	PASS
			16QAM	VN	20	-8.99	-0.01	PASS
			16QAM	VN	30	-16.1	-0.02	PASS
			16QAM	VN	40	-13.93	-0.02	PASS
			16QAM	VN	50	-13.09	-0.02	PASS
		MCH	16QAM	VN	-30	-18.73	-0.02	PASS
			16QAM	VN	-20	-0.75	0	PASS
			16QAM	VN	-10	-5.73	-0.01	PASS
			16QAM	VN	0	-15.85	-0.02	PASS
			16QAM	VN	10	1.54	0	PASS
			16QAM	VN	20	-3.89	0	PASS
			16QAM	VN	30	2.01	0	PASS
			16QAM	VN	40	1.75	0	PASS
			16QAM	VN	50	6.19	0.01	PASS
		HCH	16QAM	VN	-30	6.23	0.01	PASS
			16QAM	VN	-20	6.08	0.01	PASS
			16QAM	VN	-10	12.1	0.01	PASS
			16QAM	VN	0	21.37	0.03	PASS
			16QAM	VN	10	13.35	0.02	PASS
			16QAM	VN	20	0.84	0	PASS
			16QAM	VN	30	4.46	0.01	PASS
			16QAM	VN	40	-4.16	0	PASS
			16QAM	VN	50	16.26	0.02	PASS

Frequency Error vs. Temperature								
Test Mode	Test Bandwidth [MHz]	Test Channel	Modulation	Test Volt.	Test Temp.	Freq. Error [Hz]	Freq. vs. rated [ppm]	Verdict
TM2	5	LCH	16QAM	VN	-30	8.32	0.01	PASS
			16QAM	VN	-20	-4.53	-0.01	PASS
			16QAM	VN	-10	0.39	0	PASS
			16QAM	VN	0	-2.77	0	PASS
			16QAM	VN	10	4.32	0.01	PASS
			16QAM	VN	20	0.67	0	PASS
			16QAM	VN	30	5.16	0.01	PASS
			16QAM	VN	40	-1.13	0	PASS
			16QAM	VN	50	4.95	0.01	PASS
		MCH	16QAM	VN	-30	0.14	0	PASS
			16QAM	VN	-20	8.58	0.01	PASS
			16QAM	VN	-10	-7.62	-0.01	PASS
			16QAM	VN	0	-2.16	0	PASS
			16QAM	VN	10	-5.19	-0.01	PASS
			16QAM	VN	20	-1.06	0	PASS
			16QAM	VN	30	3.38	0	PASS
			16QAM	VN	40	1.77	0	PASS
			16QAM	VN	50	4.17	0	PASS
		HCH	16QAM	VN	-30	-2.81	0	PASS
			16QAM	VN	-20	7.73	0.01	PASS
			16QAM	VN	-10	-1.98	0	PASS
			16QAM	VN	0	-1.04	0	PASS
			16QAM	VN	10	-1.03	0	PASS
			16QAM	VN	20	3.61	0	PASS
			16QAM	VN	30	12.51	0.01	PASS
			16QAM	VN	40	6.16	0.01	PASS
			16QAM	VN	50	6.32	0.01	PASS

Frequency Error vs. Temperature								
Test Mode	Test Bandwidth [MHz]	Test Channel	Modulation	Test Volt.	Test Temp.	Freq. Error [Hz]	Freq. vs. rated [ppm]	Verdict
TM2	10	LCH	16QAM	VN	-30	0.37	0	PASS
			16QAM	VN	-20	0.29	0	PASS
			16QAM	VN	-10	-2.25	0	PASS
			16QAM	VN	0	3.89	0	PASS
			16QAM	VN	10	2.42	0	PASS
			16QAM	VN	20	-1.1	0	PASS
			16QAM	VN	30	3.94	0	PASS
			16QAM	VN	40	0.4	0	PASS
			16QAM	VN	50	0.15	0	PASS
		MCH	16QAM	VN	-30	1.25	0	PASS
			16QAM	VN	-20	5.53	0.01	PASS
			16QAM	VN	-10	4.13	0	PASS
			16QAM	VN	0	-1.35	0	PASS
			16QAM	VN	10	2.24	0	PASS
			16QAM	VN	20	-1.89	0	PASS
			16QAM	VN	30	-2.52	0	PASS
			16QAM	VN	40	-3.77	0	PASS
			16QAM	VN	50	-1.58	0	PASS
		HCH	16QAM	VN	-30	0.02	0	PASS
			16QAM	VN	-20	3.67	0	PASS
			16QAM	VN	-10	-3.25	0	PASS
			16QAM	VN	0	0.18	0	PASS
			16QAM	VN	10	-1.43	0	PASS
			16QAM	VN	20	2.12	0	PASS
			16QAM	VN	30	-1.53	0	PASS
			16QAM	VN	40	-3.1	0	PASS
			16QAM	VN	50	-4.5	-0.01	PASS

End of Test Report