



|      |      |      |      |         |        |      |       |         |      |      |
|------|------|------|------|---------|--------|------|-------|---------|------|------|
| NVNT | ac20 | 5260 | Ant2 | 5150    | -56.7  | 3.27 | 41.80 | Average | 54   | Pass |
| NVNT | ac20 | 5320 | Ant2 | 5350    | -41.1  | 3.27 | 57.40 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5320 | Ant2 | 5350    | -49.8  | 3.27 | 48.70 | Average | 54   | Pass |
| NVNT | ac20 | 5320 | Ant2 | 5350.6  | -34.05 | 3.27 | 64.45 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5320 | Ant2 | 5350    | -49.8  | 3.27 | 48.70 | Average | 54   | Pass |
| NVNT | ac20 | 5320 | Ant2 | 5460    | -48.97 | 3.27 | 49.53 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5320 | Ant2 | 5460    | -57.97 | 3.27 | 40.53 | Average | 54   | Pass |
| NVNT | ac40 | 5270 | Ant2 | 4500    | -52.62 | 3.27 | 45.88 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5270 | Ant2 | 4500    | -59.29 | 3.27 | 39.21 | Average | 54   | Pass |
| NVNT | ac40 | 5270 | Ant2 | 4806.99 | -45.55 | 3.27 | 52.95 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5270 | Ant2 | 4806.99 | -52.7  | 3.27 | 45.80 | Average | 54   | Pass |
| NVNT | ac40 | 5270 | Ant2 | 5150    | -50.92 | 3.27 | 47.58 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5270 | Ant2 | 5150    | -57.28 | 3.27 | 41.22 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | Ant2 | 5350    | -37.37 | 3.27 | 61.13 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | Ant2 | 5350    | -49.88 | 3.27 | 48.62 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | Ant2 | 5350    | -37.37 | 3.27 | 61.13 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | Ant2 | 5350.2  | -49.85 | 3.27 | 48.65 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | Ant2 | 5460    | -51.08 | 3.27 | 47.42 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | Ant2 | 5460    | -57.87 | 3.27 | 40.63 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant2 | 5350    | -46.84 | 3.27 | 51.66 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant2 | 5350    | -53.2  | 3.27 | 45.30 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant2 | 5354.5  | -43.02 | 3.27 | 55.48 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant2 | 5350.25 | -53.01 | 3.27 | 45.49 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant2 | 5460    | -50.02 | 3.27 | 48.48 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant2 | 5460    | -57.13 | 3.27 | 41.37 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant2 | 4500    | -53.1  | 3.27 | 45.40 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant2 | 4500    | -59.11 | 3.27 | 39.39 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant2 | 4971.54 | -47.19 | 3.27 | 51.31 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant2 | 5114.22 | -56.64 | 3.27 | 41.86 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant2 | 5150    | -51.35 | 3.27 | 47.15 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant2 | 5150    | -57.1  | 3.27 | 41.40 | Average | 54   | Pass |




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

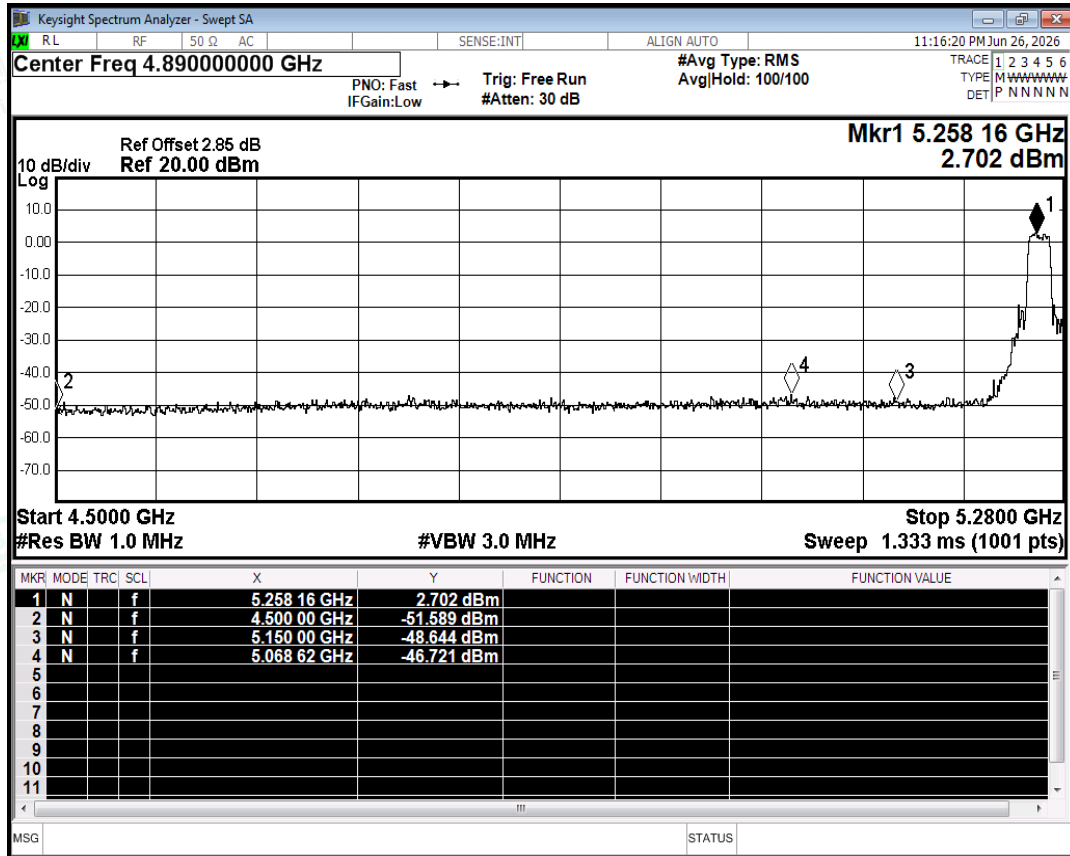

Restrict Band NVNT a 5260MHz Ant2 Peak

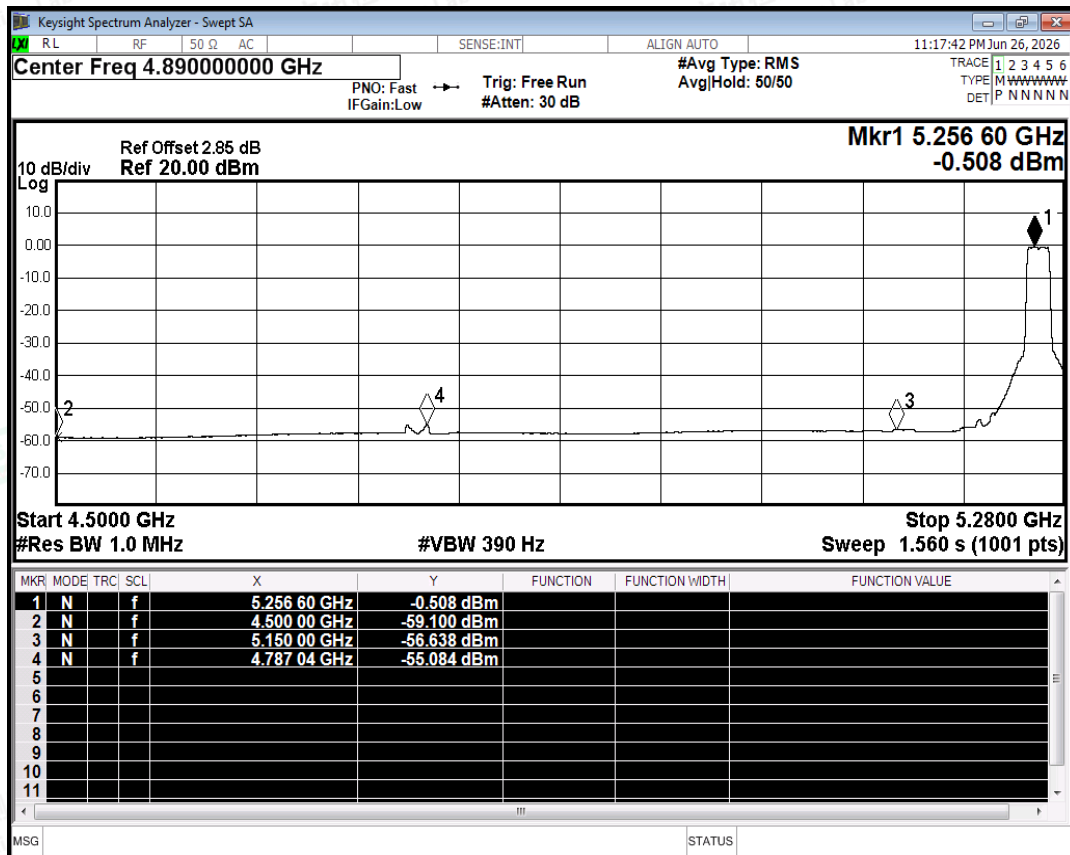

Restrict Band NVNT a 5260MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

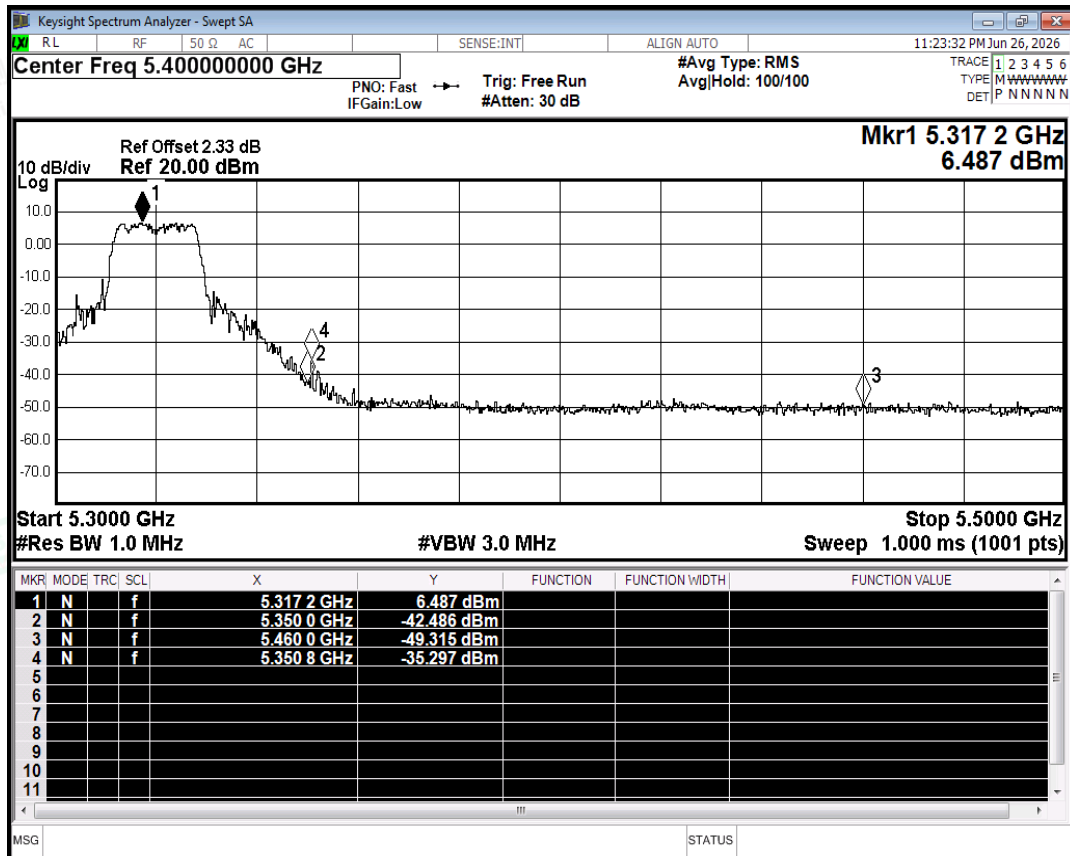

Restrict Band NVNT a 5320MHz Ant2 Peak

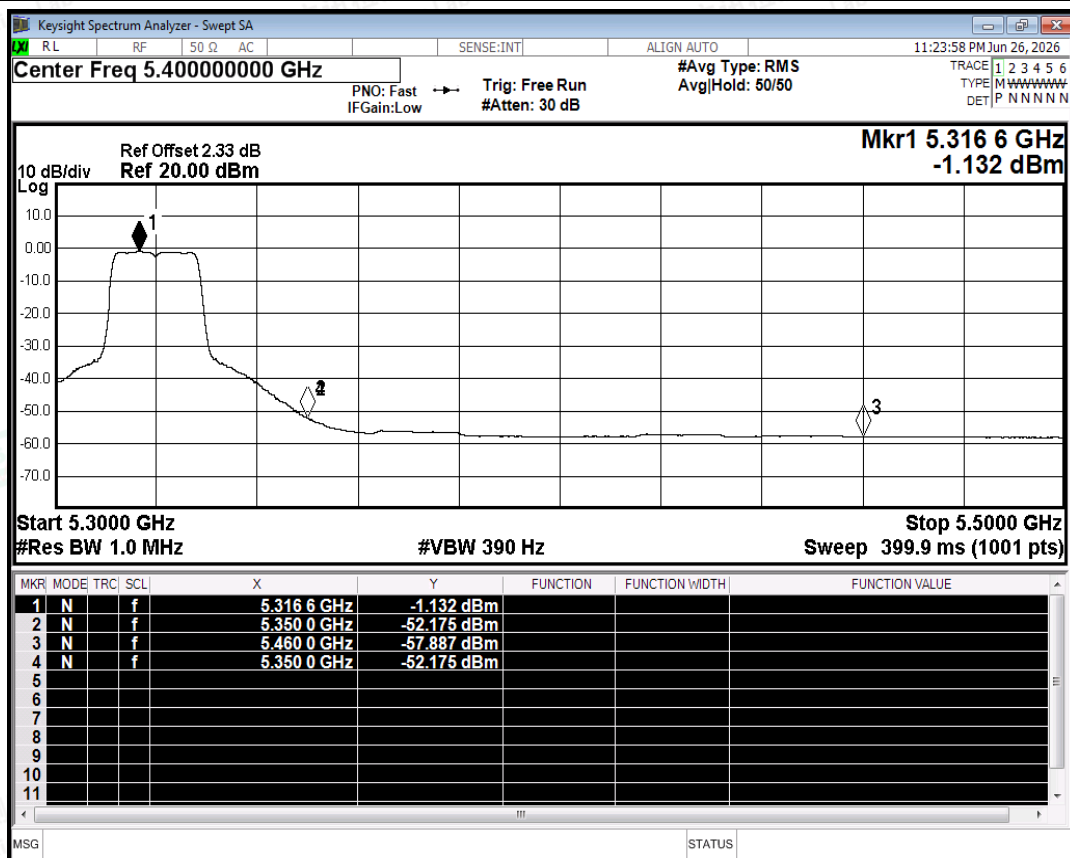

Restrict Band NVNT a 5320MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

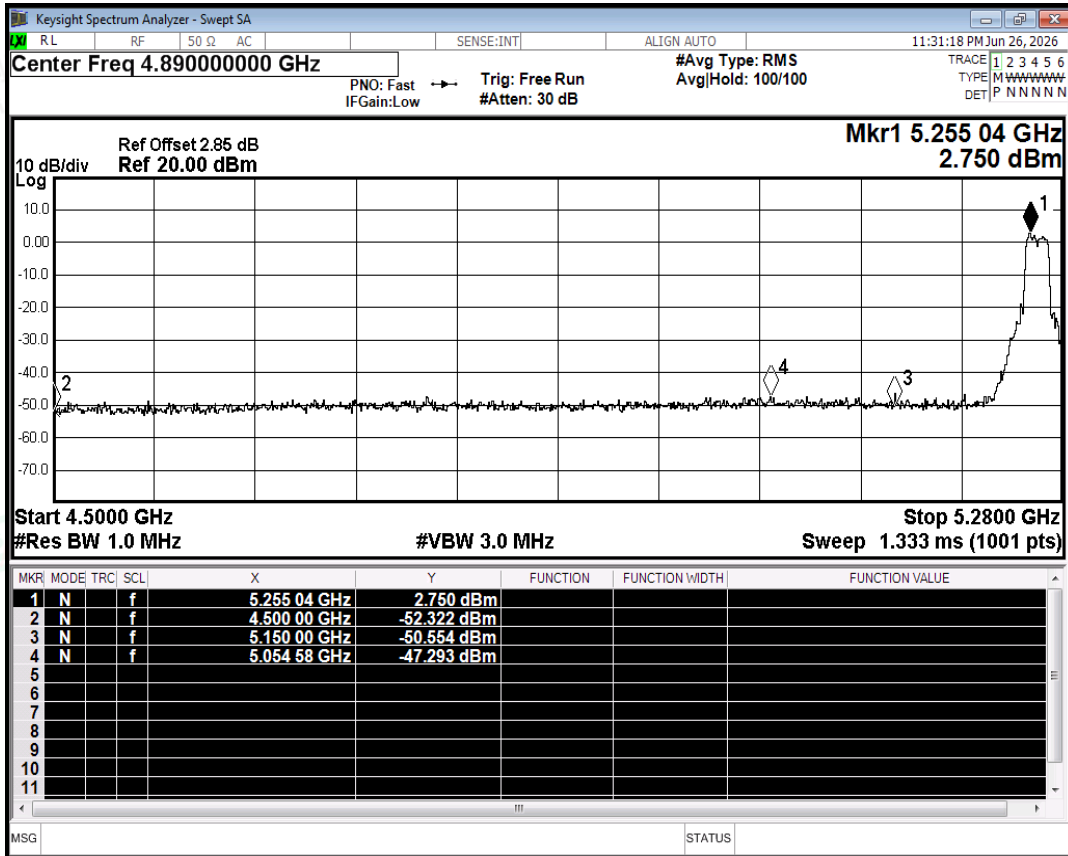

Restrict Band NVNT n20 5260MHz Ant2 Peak

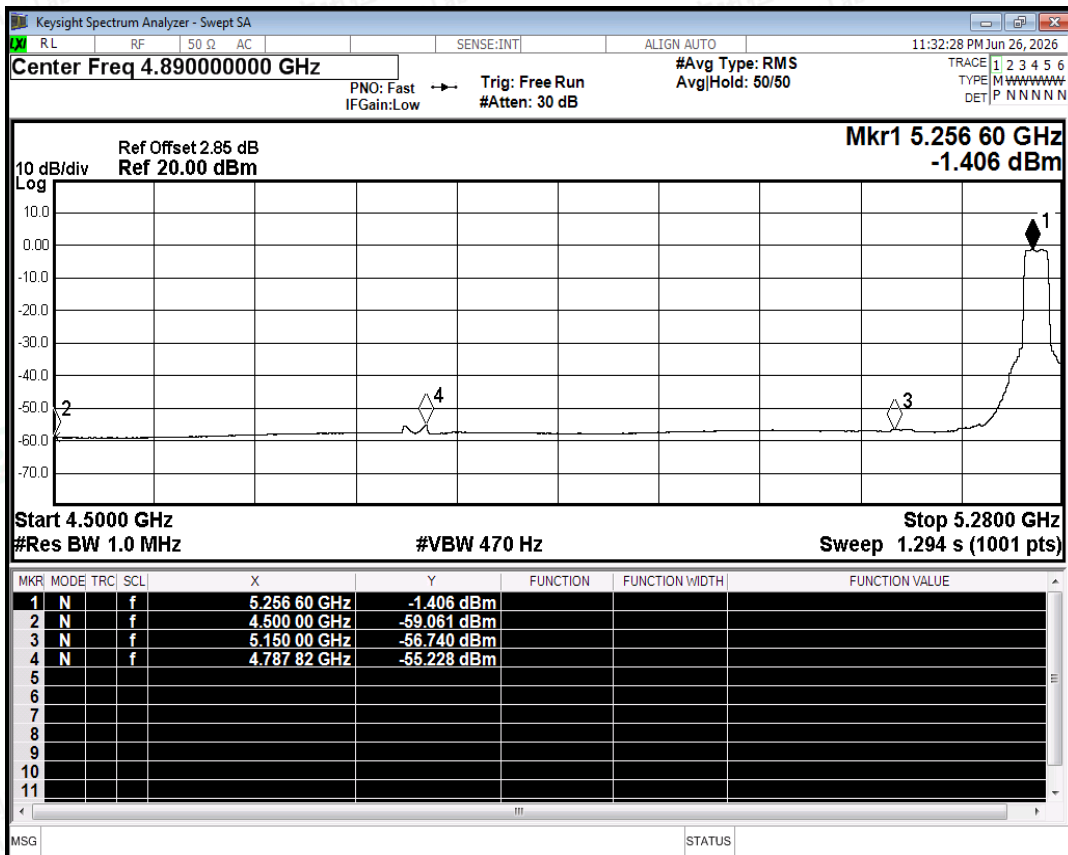

Restrict Band NVNT n20 5260MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

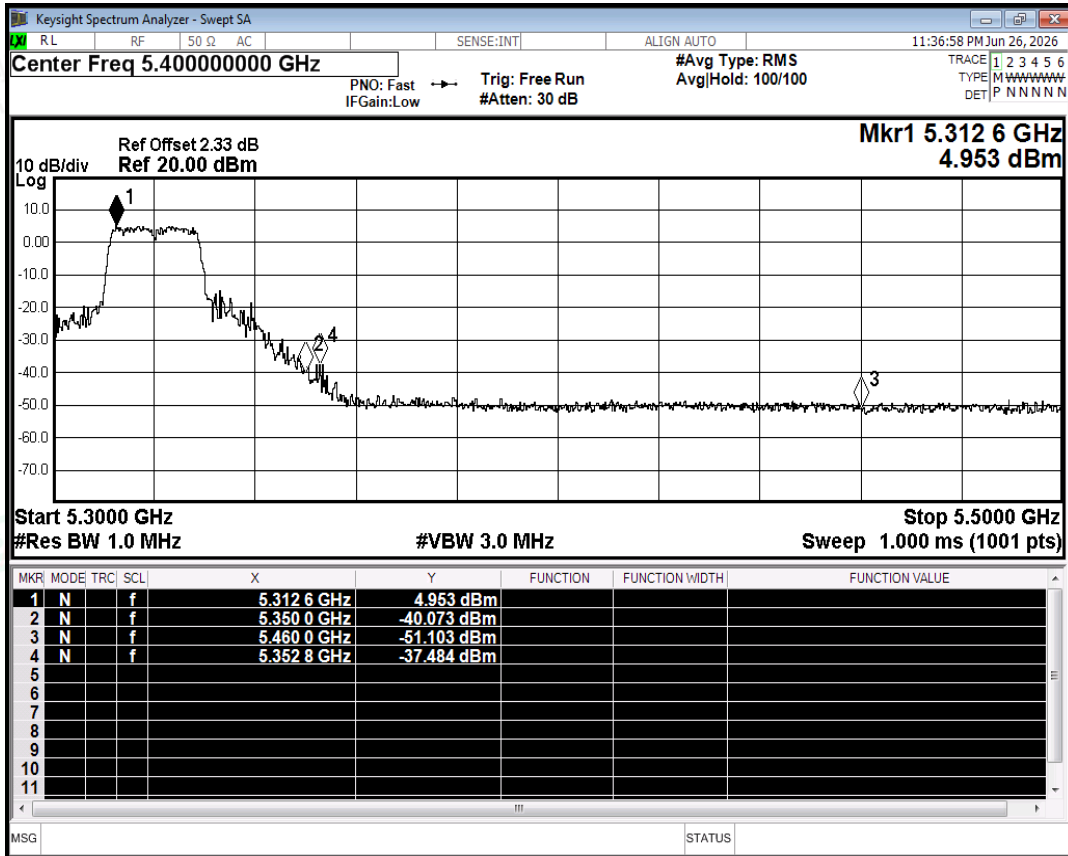

Restrict Band NVNT n20 5320MHz Ant2 Peak

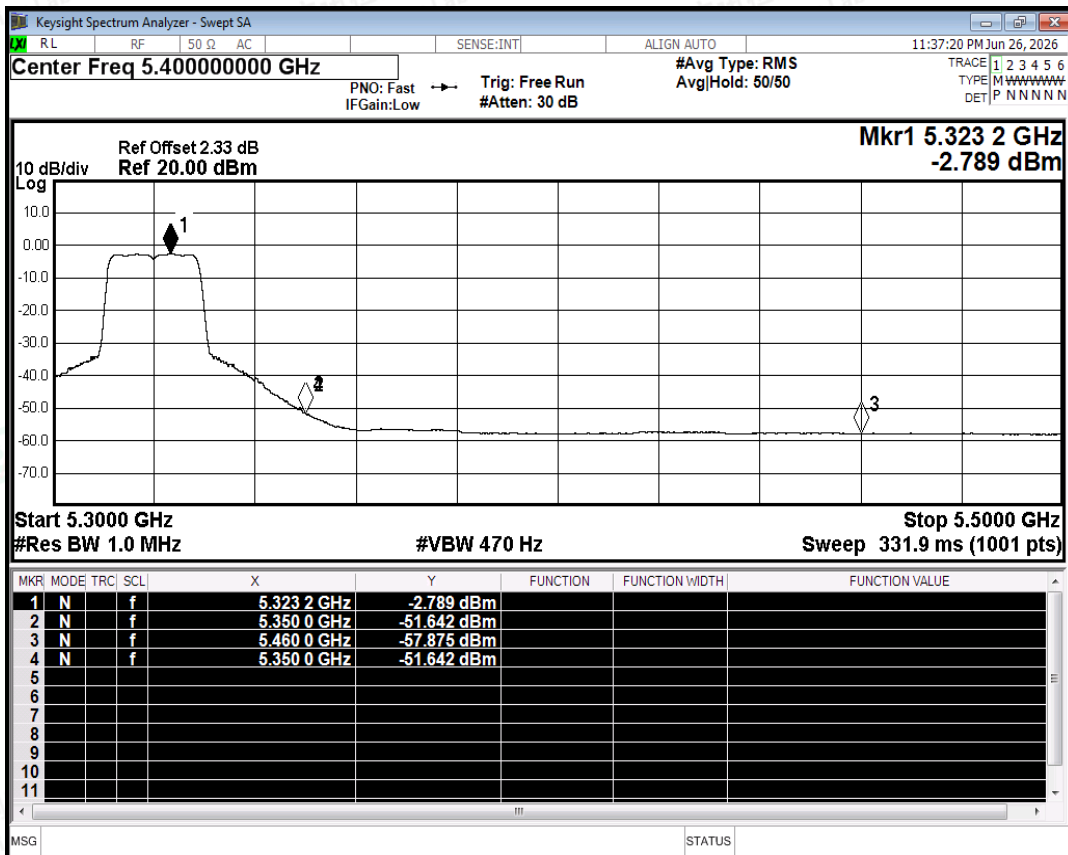

Restrict Band NVNT n20 5320MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

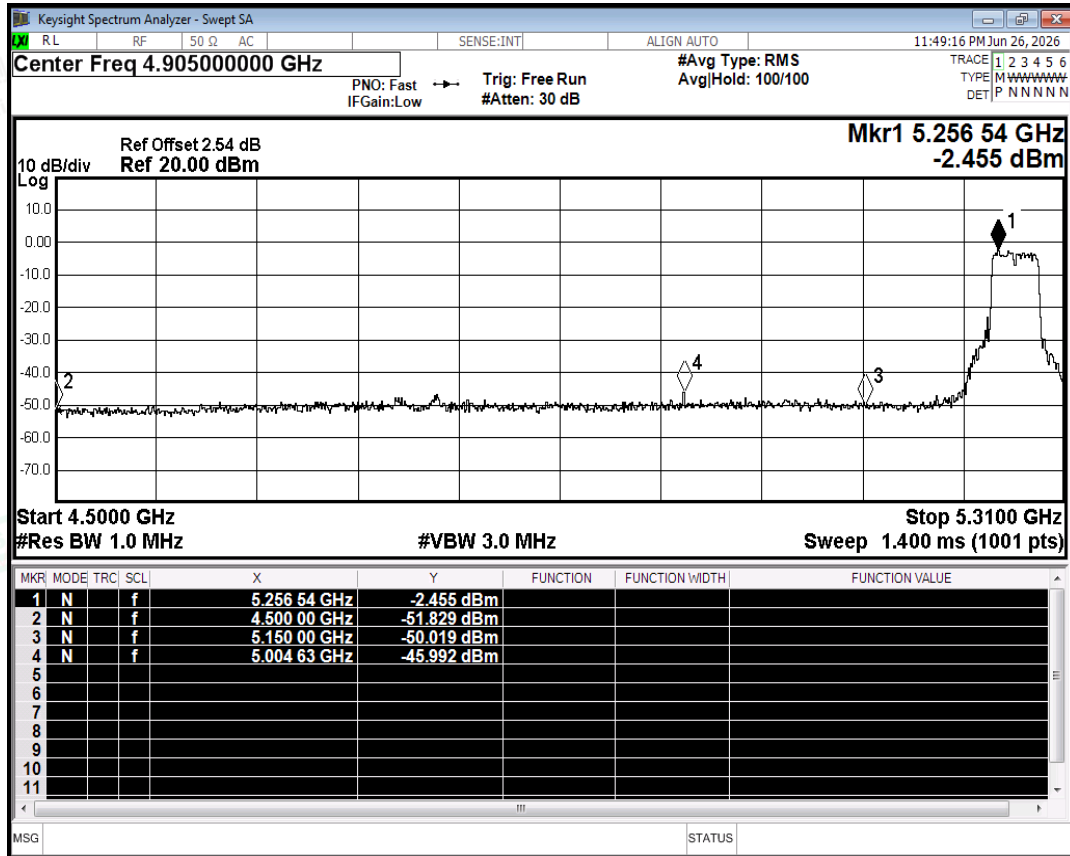

Restrict Band NVNT n40 5270MHz Ant2 Peak

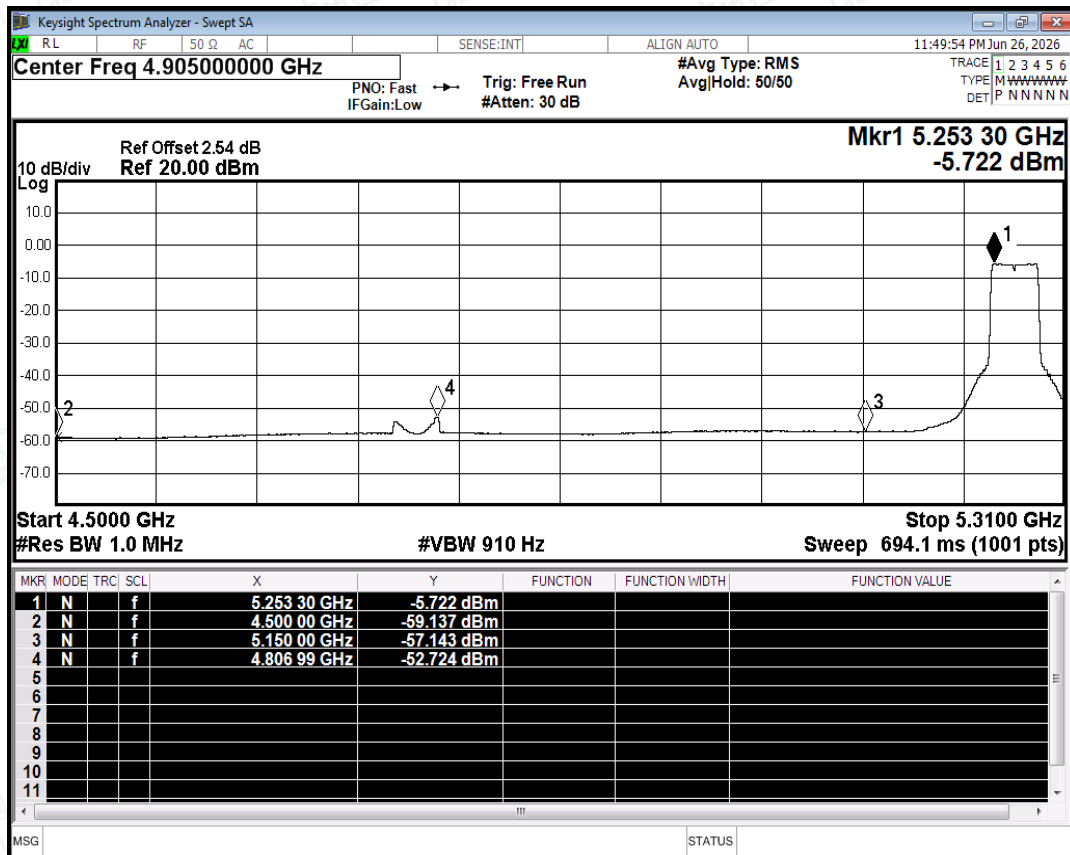

Restrict Band NVNT n40 5270MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

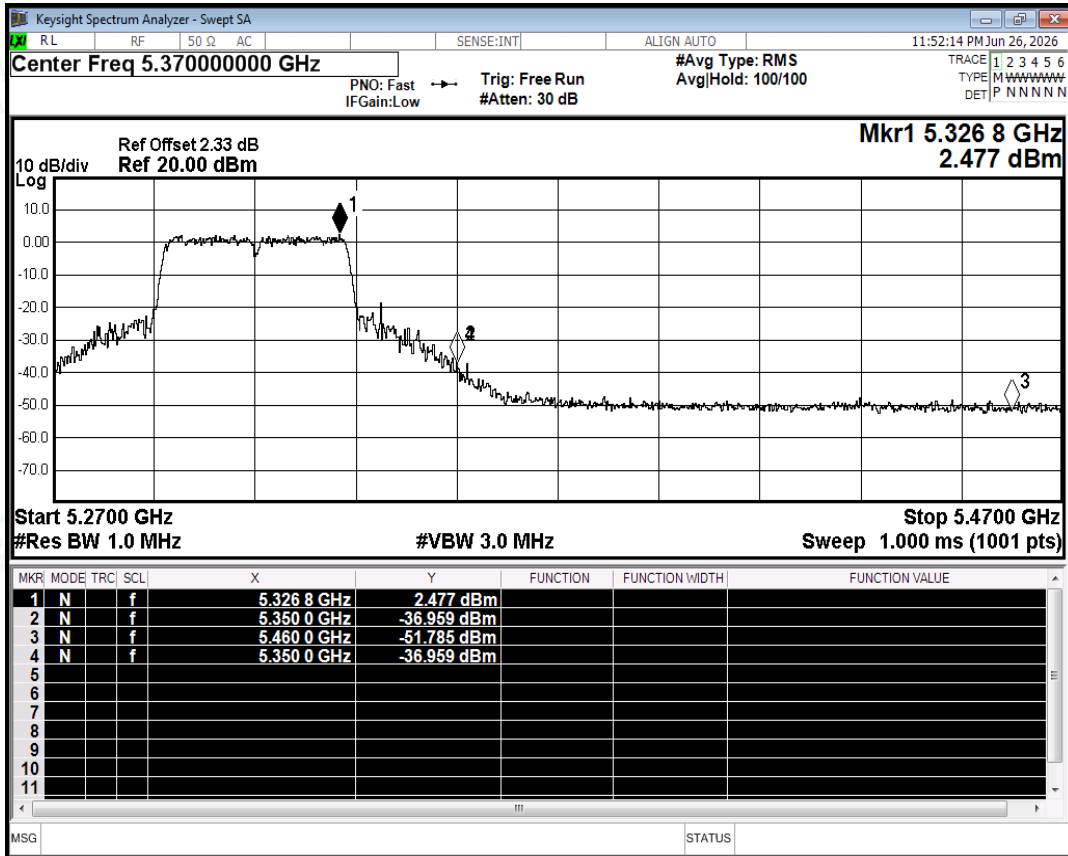

Restrict Band NVNT n40 5310MHz Ant2 Peak

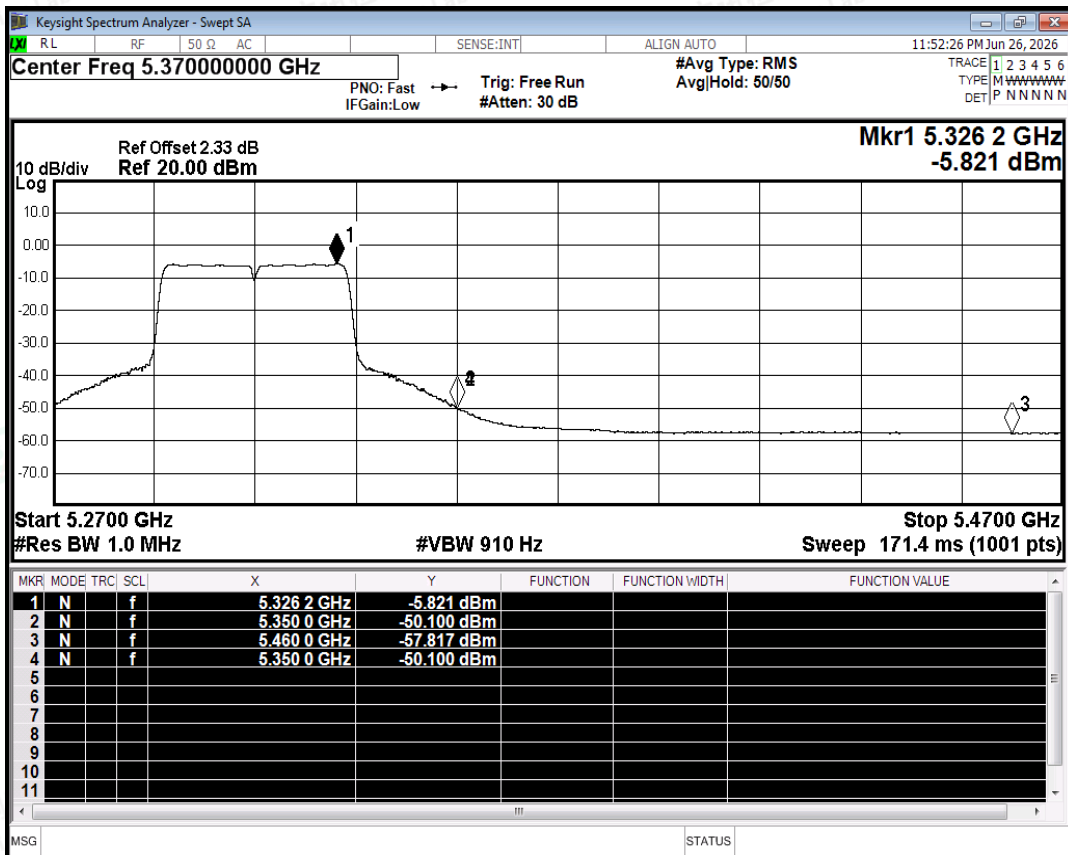

Restrict Band NVNT n40 5310MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

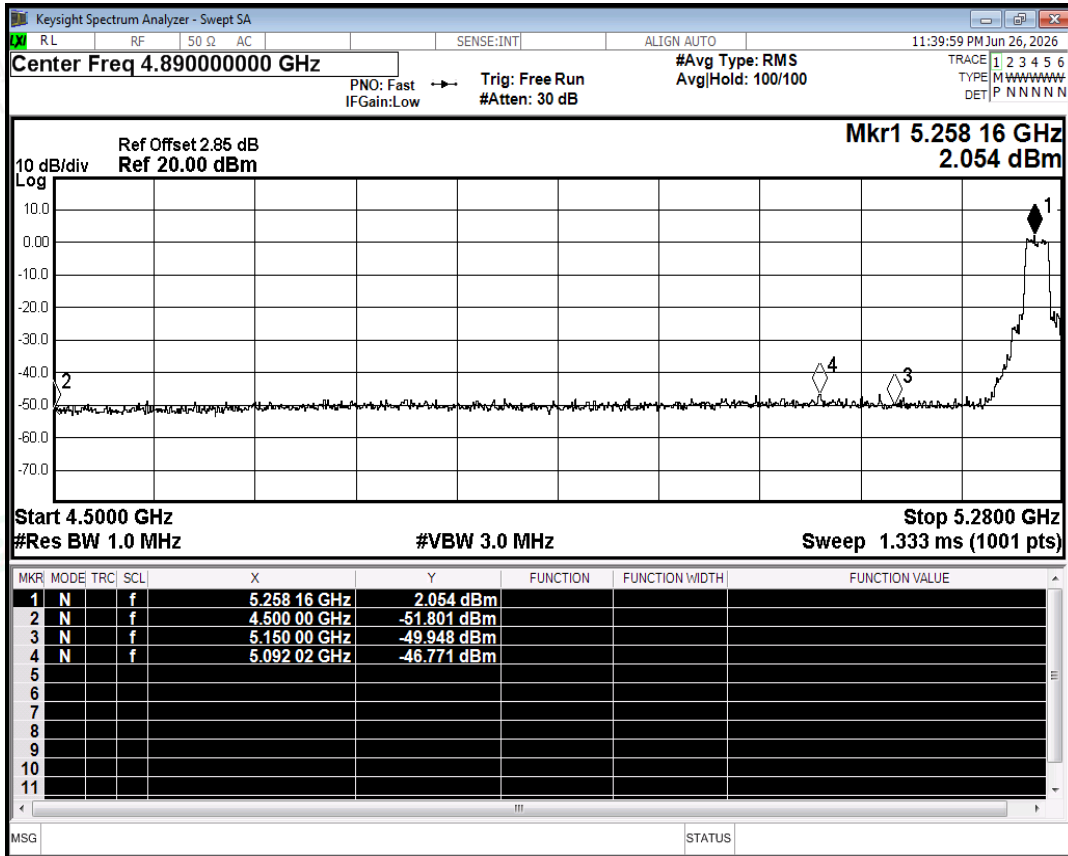

Restrict Band NVNT ac20 5260MHz Ant2 Peak

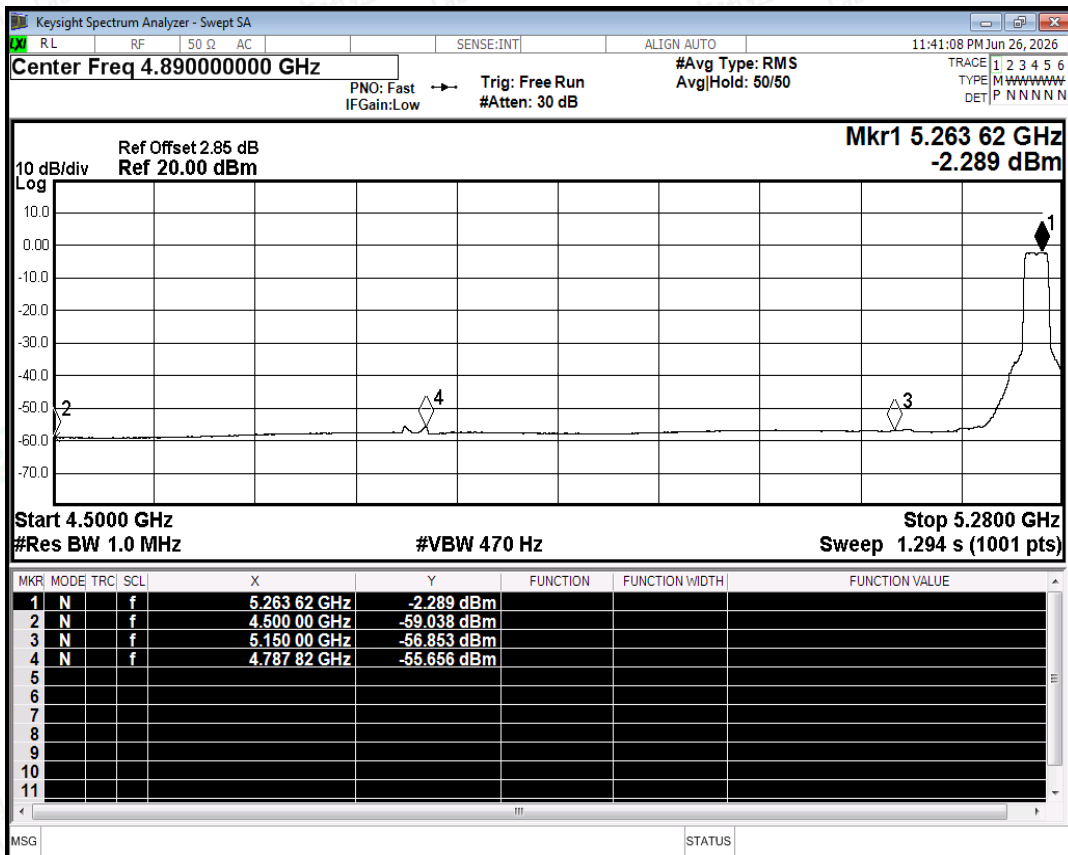

Restrict Band NVNT ac20 5260MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

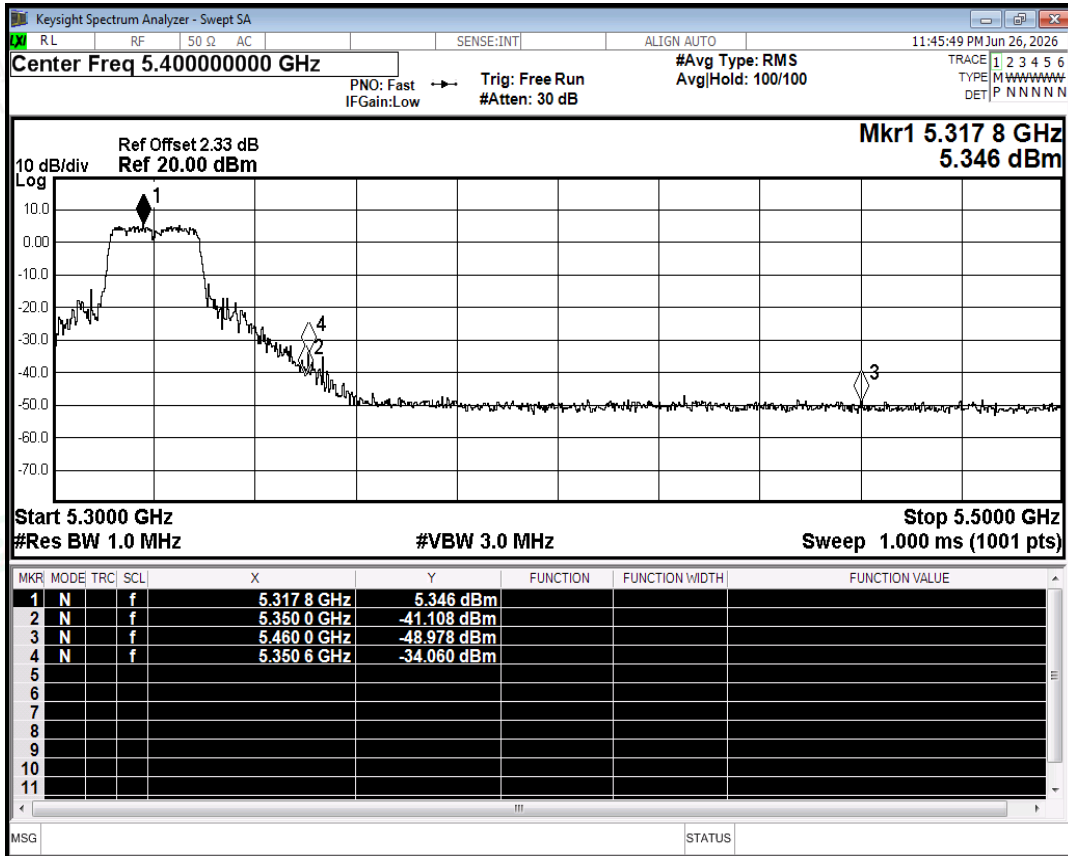

Restrict Band NVNT ac20 5320MHz Ant2 Peak

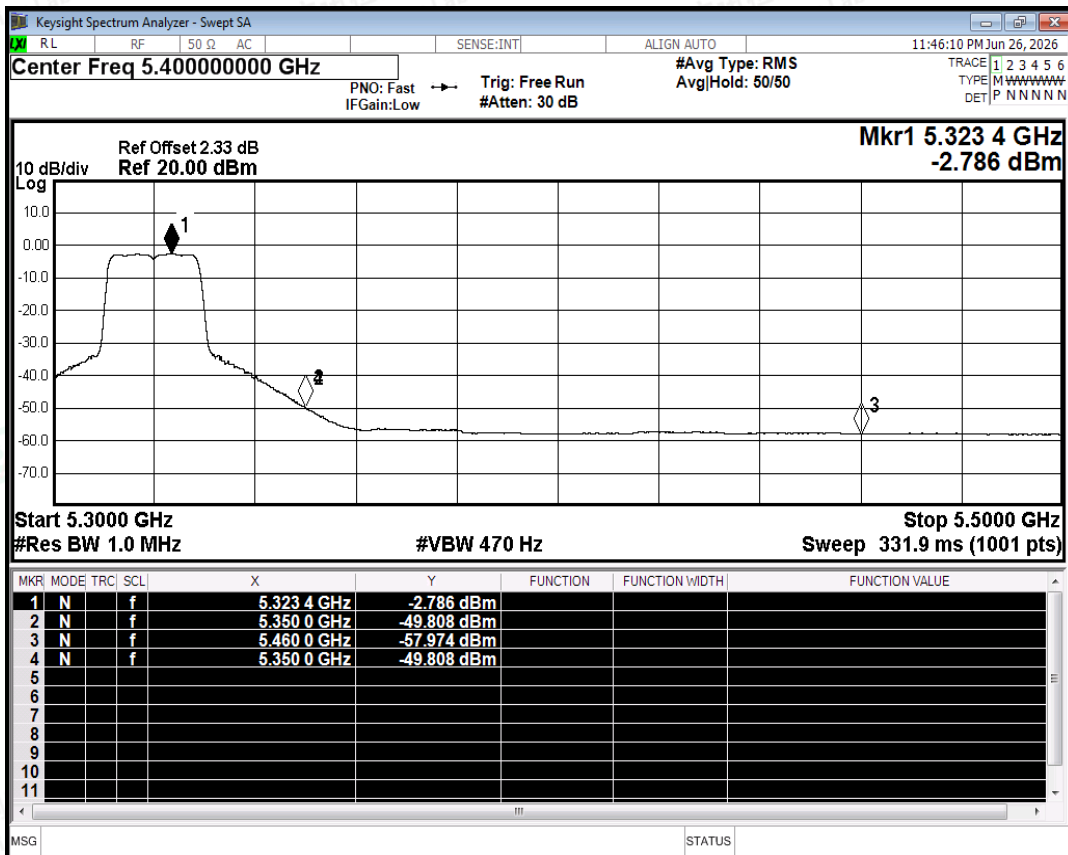

Restrict Band NVNT ac20 5320MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

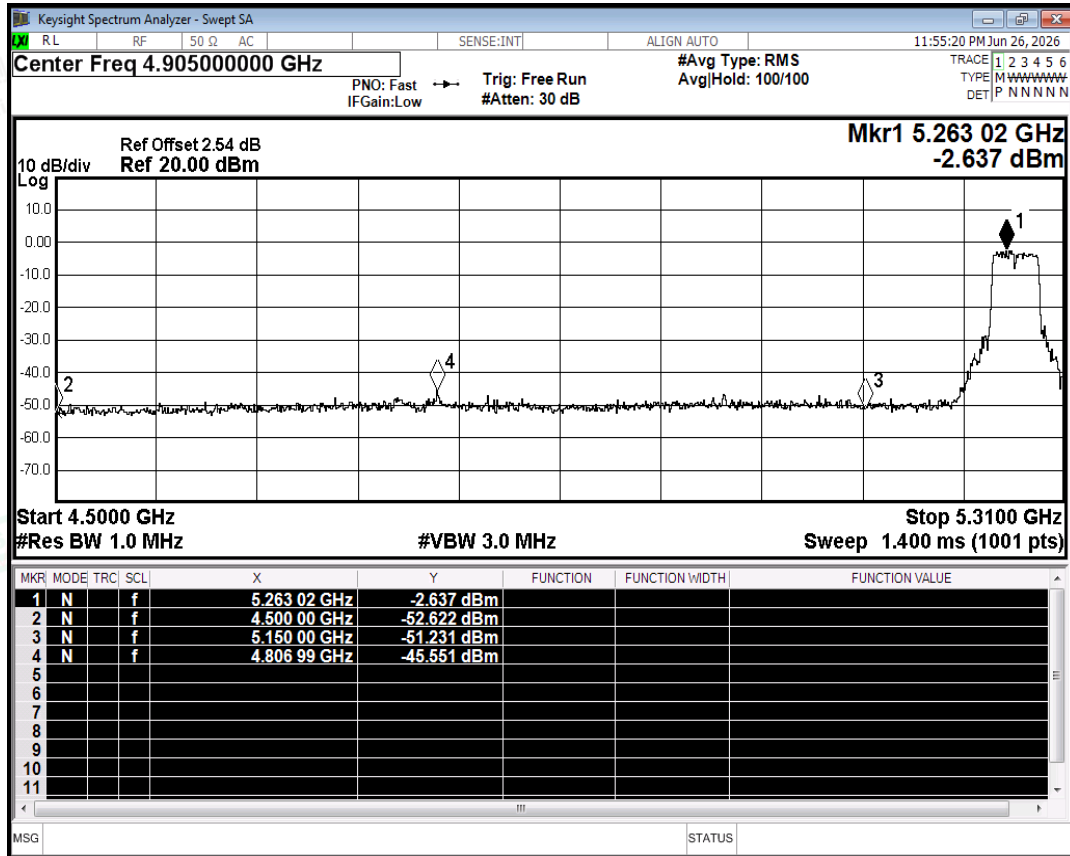

Restrict Band NVNT ac40 5270MHz Ant2 Peak

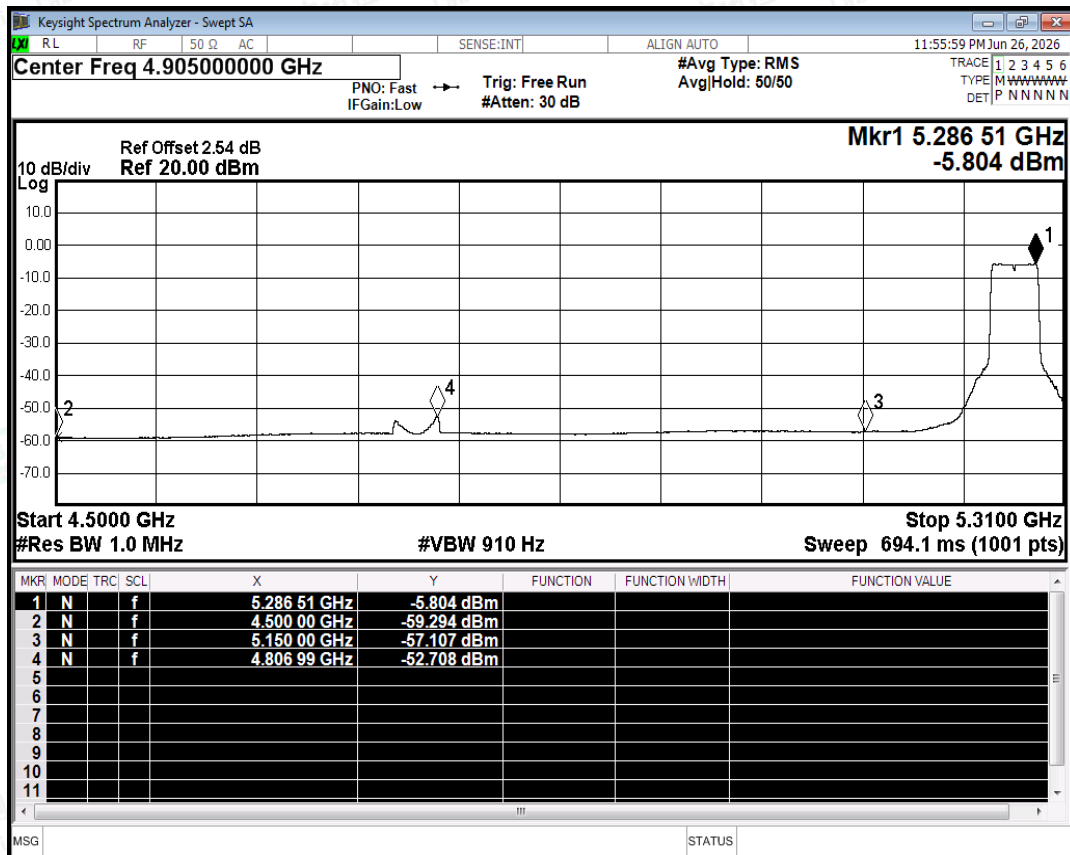

Restrict Band NVNT ac40 5270MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

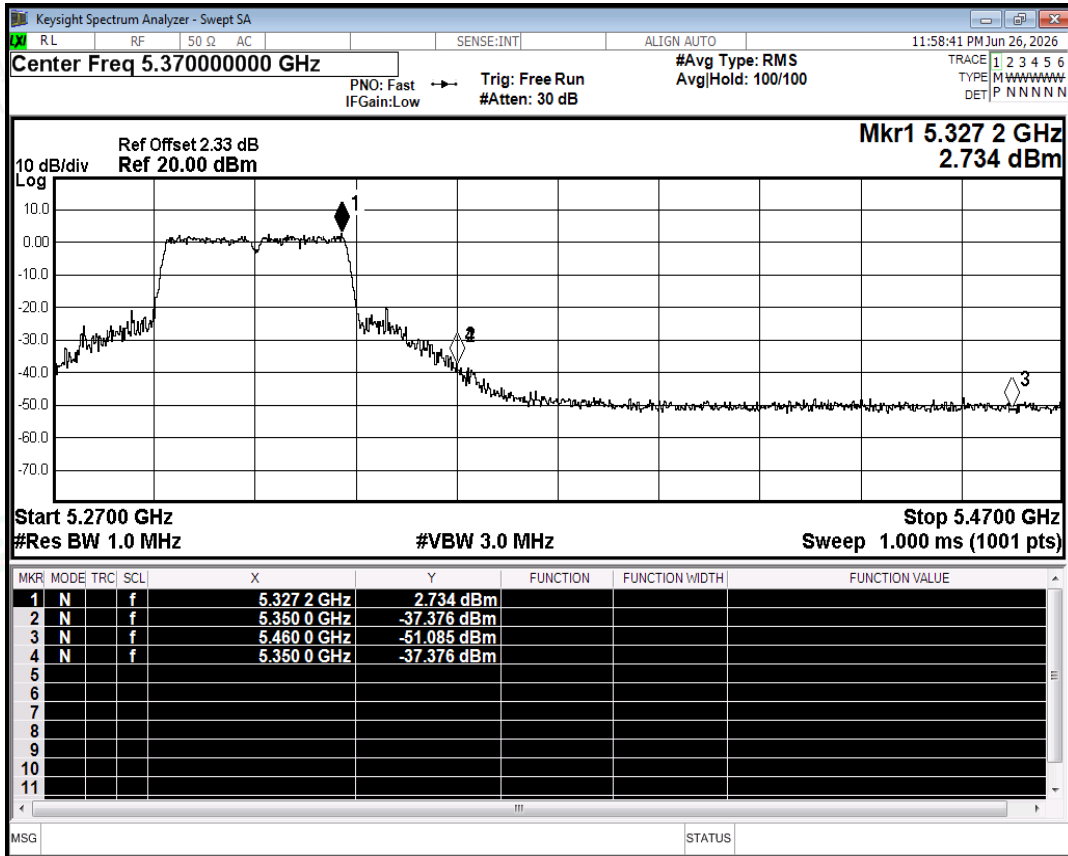

Restrict Band NVNT ac40 5310MHz Ant2 Peak

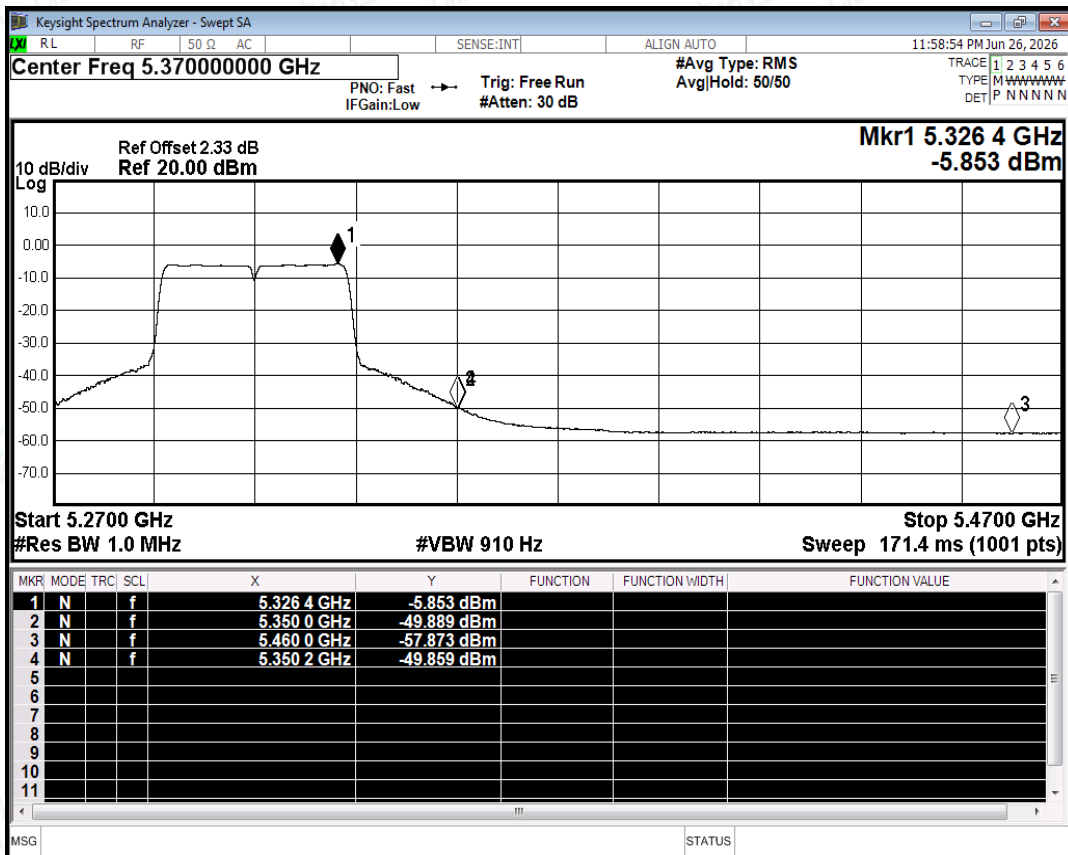

Restrict Band NVNT ac40 5310MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

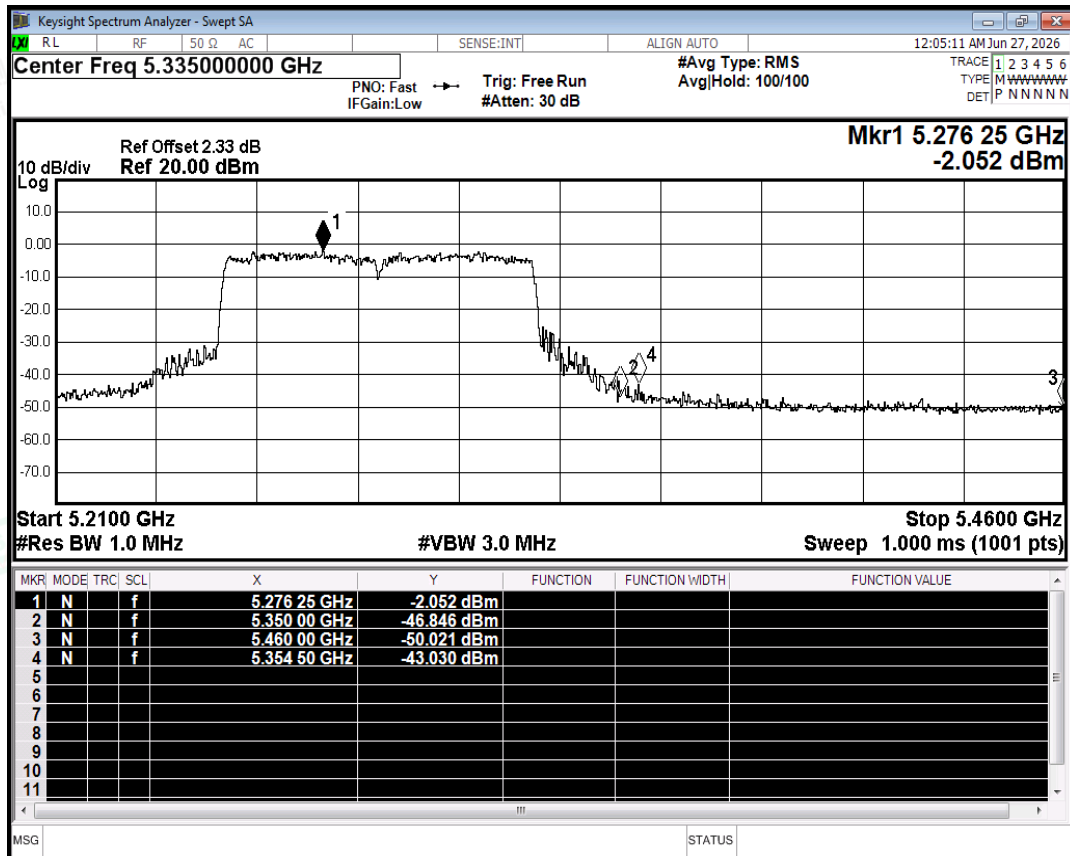

Restrict Band NVNT ac80 5290MHz Ant2 Peak

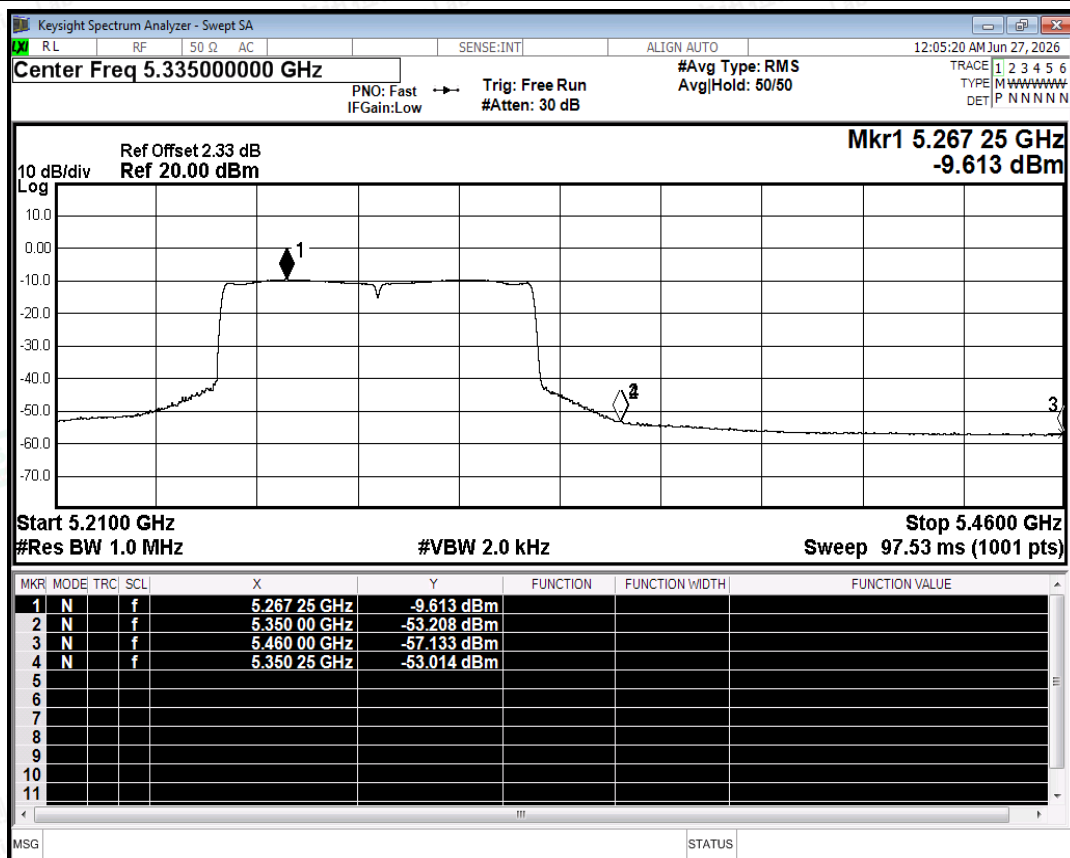

Restrict Band NVNT ac80 5290MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

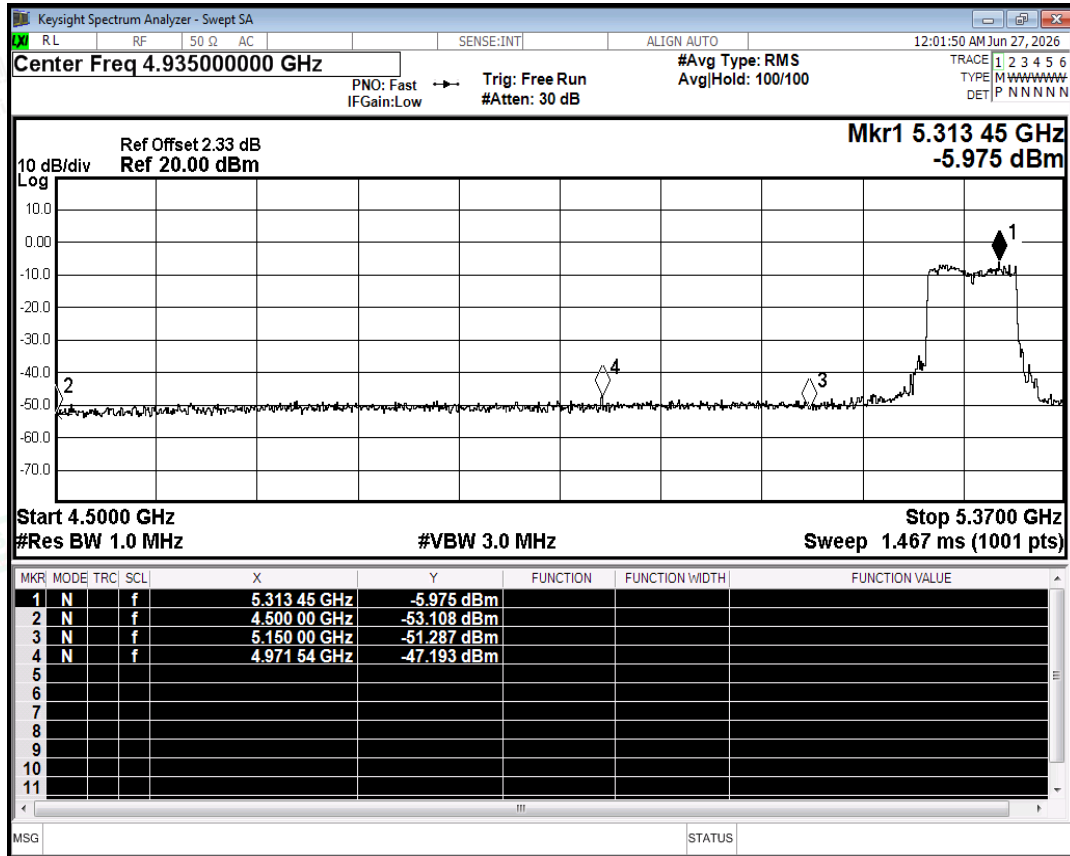

Restrict Band NVNT ac80 5290MHz Ant2 Peak

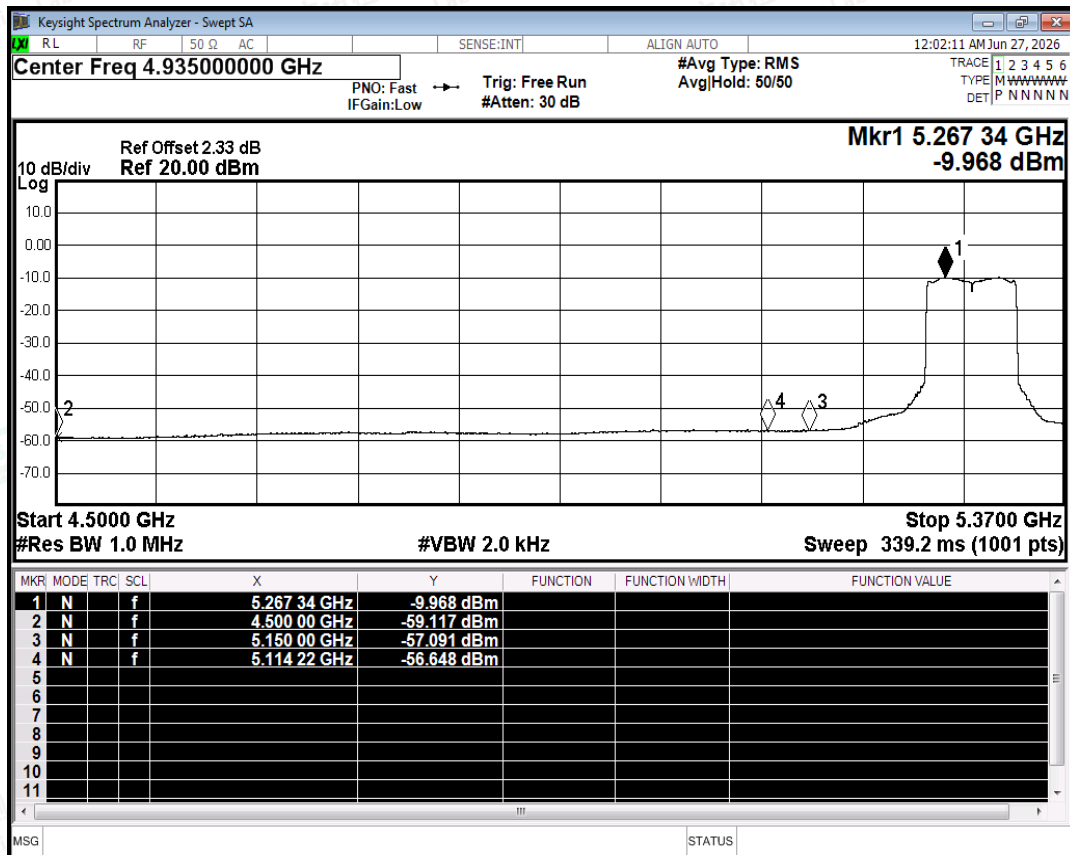

Restrict Band NVNT ac80 5290MHz Ant2 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

**MIMO**

| Condition | Mode | Frequency<br>(MHz) | Ant1<br>Power<br>(dBm) | Ant2<br>Power<br>(dBm) | Gain<br>(dBi) | E (dBuV/m) | Detector | Limit<br>(dBuV/m) | Verdict |
|-----------|------|--------------------|------------------------|------------------------|---------------|------------|----------|-------------------|---------|
| NVNT      | n20  | 5260               | -52.68                 | -52.45                 | 6.28          | 51.95      | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5260               | -59.18                 | -59.13                 | 6.28          | 45.36      | Average  | 54                | Pass    |
| NVNT      | n20  | 5260               | -46.88                 | -47.50                 | 6.28          | 57.34      | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5260               | -55.02                 | -55.32                 | 6.28          | 49.35      | Average  | 54                | Pass    |
| NVNT      | n20  | 5260               | -49.40                 | -46.67                 | 6.28          | 56.69      | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5260               | -56.77                 | -56.84                 | 6.28          | 47.71      | Average  | 54                | Pass    |
| NVNT      | n20  | 5320               | -34.83                 | -40.26                 | 6.28          | 67.77      | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5320               | -58.66                 | -51.80                 | 6.28          | 50.52      | Average  | 54                | Pass    |
| NVNT      | n20  | 5320               | -34.76                 | -47.66                 | 6.28          | 66.96      | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5320               | -58.56                 | -51.73                 | 6.28          | 50.60      | Average  | 54                | Pass    |
| NVNT      | n20  | 5320               | -50.77                 | -51.30                 | 6.28          | 53.49      | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5320               | -58.02                 | -58.03                 | 6.28          | 46.49      | Average  | 54                | Pass    |
| NVNT      | n40  | 5270               | -51.99                 | -51.90                 | 6.28          | 52.57      | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5270               | -59.27                 | -59.32                 | 6.28          | 45.22      | Average  | 54                | Pass    |
| NVNT      | n40  | 5270               | -46.85                 | -46.14                 | 6.28          | 58.04      | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5270               | -53.01                 | -52.75                 | 6.28          | 51.64      | Average  | 54                | Pass    |
| NVNT      | n40  | 5270               | -49.81                 | -51.05                 | 6.28          | 54.13      | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5270               | -57.37                 | -57.22                 | 6.28          | 47.22      | Average  | 54                | Pass    |
| NVNT      | n40  | 5310               | -38.80                 | -37.08                 | 6.28          | 66.66      | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5310               | -50.50                 | -55.15                 | 6.28          | 52.29      | Average  | 54                | Pass    |
| NVNT      | n40  | 5310               | -37.28                 | -37.13                 | 6.28          | 67.31      | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5310               | -55.21                 | -50.28                 | 6.28          | 52.44      | Average  | 54                | Pass    |
| NVNT      | n40  | 5310               | -52.14                 | -51.87                 | 6.28          | 52.51      | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5310               | -57.69                 | -57.88                 | 6.28          | 46.73      | Average  | 54                | Pass    |
| NVNT      | ac20 | 5260               | -52.14                 | -51.94                 | 6.28          | 52.48      | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5260               | -58.97                 | -59.21                 | 6.28          | 45.43      | Average  | 54                | Pass    |
| NVNT      | ac20 | 5260               | -46.89                 | -46.83                 | 6.28          | 57.66      | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5260               | -55.50                 | -55.82                 | 6.28          | 48.86      | Average  | 54                | Pass    |
| NVNT      | ac20 | 5260               | -50.45                 | -49.76                 | 6.28          | 54.43      | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5260               | -56.80                 | -56.74                 | 6.28          | 47.75      | Average  | 54                | Pass    |
| NVNT      | ac20 | 5320               | -38.93                 | -41.20                 | 6.28          | 64.60      | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5320               | -49.21                 | -59.86                 | 6.28          | 52.66      | Average  | 54                | Pass    |
| NVNT      | ac20 | 5320               | -36.19                 | -44.22                 | 6.28          | 65.95      | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5320               | -49.19                 | -59.89                 | 6.28          | 52.67      | Average  | 54                | Pass    |
| NVNT      | ac20 | 5320               | -49.37                 | -49.05                 | 6.28          | 55.31      | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5320               | -58.02                 | -58.18                 | 6.28          | 46.42      | Average  | 54                | Pass    |
| NVNT      | ac40 | 5270               | -52.18                 | -52.77                 | 6.28          | 52.05      | Peak     | 68.2              | Pass    |
| NVNT      | ac40 | 5270               | -59.41                 | -59.43                 | 6.28          | 45.10      | Average  | 54                | Pass    |
| NVNT      | ac40 | 5270               | -46.22                 | -45.67                 | 6.28          | 58.58      | Peak     | 68.2              | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |        |        |      |       |         |      |      |
|------|------|------|--------|--------|------|-------|---------|------|------|
| NVNT | ac40 | 5270 | -53.00 | -52.86 | 6.28 | 51.59 | Average | 54   | Pass |
| NVNT | ac40 | 5270 | -50.45 | -51.08 | 6.28 | 53.76 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5270 | -57.34 | -57.44 | 6.28 | 47.13 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | -37.96 | -37.58 | 6.28 | 66.75 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | -50.03 | -60.03 | 6.28 | 51.89 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | -37.56 | -37.46 | 6.28 | 67.01 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | -50.09 | -60.01 | 6.28 | 51.84 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | -50.29 | -51.17 | 6.28 | 53.81 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | -57.95 | -57.99 | 6.28 | 46.55 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | -44.87 | -46.97 | 6.28 | 58.72 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | -51.66 | -53.38 | 6.28 | 52.08 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | -42.99 | -43.22 | 6.28 | 61.41 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | -51.64 | -53.15 | 6.28 | 52.19 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | -50.82 | -50.06 | 6.28 | 54.09 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | -57.50 | -57.33 | 6.28 | 47.10 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | -53.45 | -53.20 | 6.28 | 51.19 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | -59.25 | -59.21 | 6.28 | 45.29 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | -47.87 | -47.31 | 6.28 | 56.94 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | -56.50 | -56.73 | 6.28 | 47.90 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | -50.04 | -51.57 | 6.28 | 53.78 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | -56.98 | -57.14 | 6.28 | 47.46 | Average | 54   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## C.5 Frequency Stability

| Condition | Mode | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | a    | 5260            | Ant1    | 5259.98                  | -20000               | -3.8            | 25          | Pass    |
| NVNT      | a    | 5280            | Ant1    | 5280                     | 0                    | 0               | 25          | Pass    |
| NVNT      | a    | 5320            | Ant1    | 5320                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n20  | 5260            | Ant1    | 5259.98                  | -20000               | -3.8            | 25          | Pass    |
| NVNT      | n20  | 5280            | Ant1    | 5279.96                  | -40000               | -7.58           | 25          | Pass    |
| NVNT      | n20  | 5320            | Ant1    | 5319.96                  | -40000               | -7.52           | 25          | Pass    |
| NVNT      | n40  | 5270            | Ant1    | 5270                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n40  | 5310            | Ant1    | 5309.96                  | -40000               | -7.53           | 25          | Pass    |
| NVNT      | ac20 | 5260            | Ant1    | 5259.96                  | -40000               | -7.6            | 25          | Pass    |
| NVNT      | ac20 | 5280            | Ant1    | 5279.98                  | -20000               | -3.79           | 25          | Pass    |
| NVNT      | ac20 | 5320            | Ant1    | 5319.96                  | -40000               | -7.52           | 25          | Pass    |
| NVNT      | ac40 | 5270            | Ant1    | 5270                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac40 | 5310            | Ant1    | 5309.96                  | -40000               | -7.53           | 25          | Pass    |
| NVNT      | ac80 | 5290            | Ant1    | 5290                     | 0                    | 0               | 25          | Pass    |




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

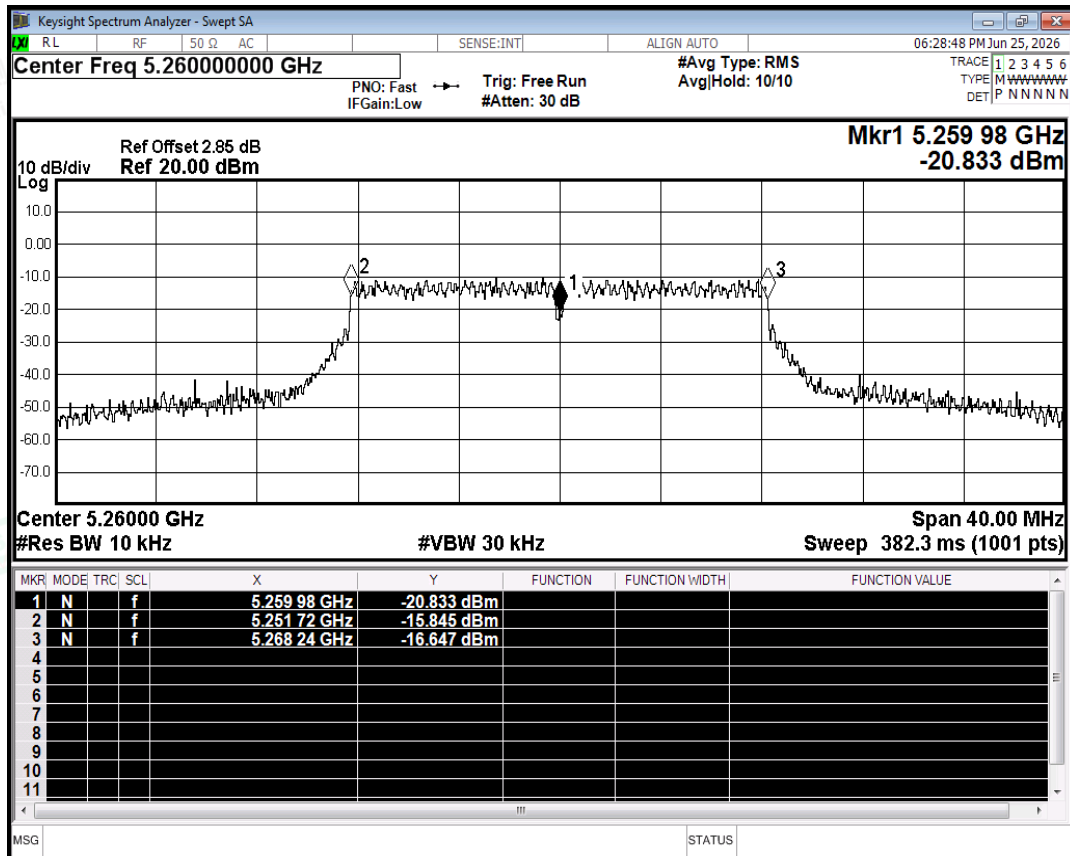

Freq. Stability NVNT a 5260MHz Ant1

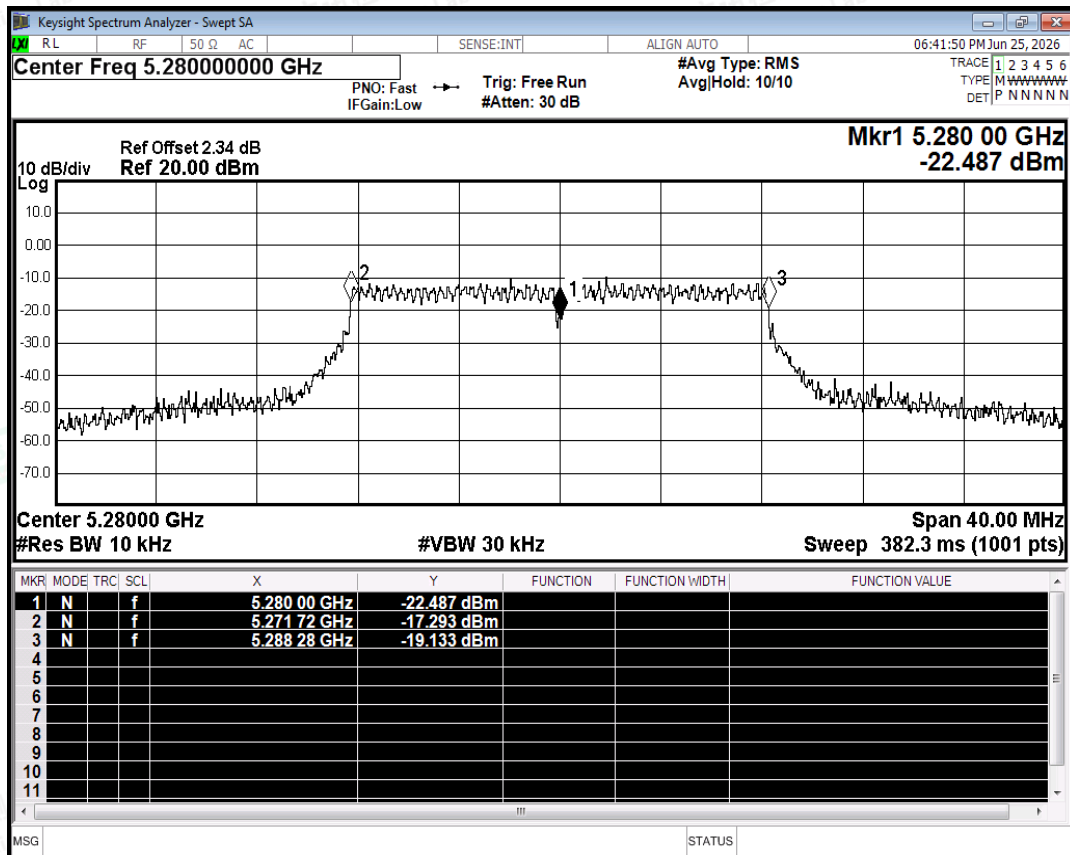

Freq. Stability NVNT a 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

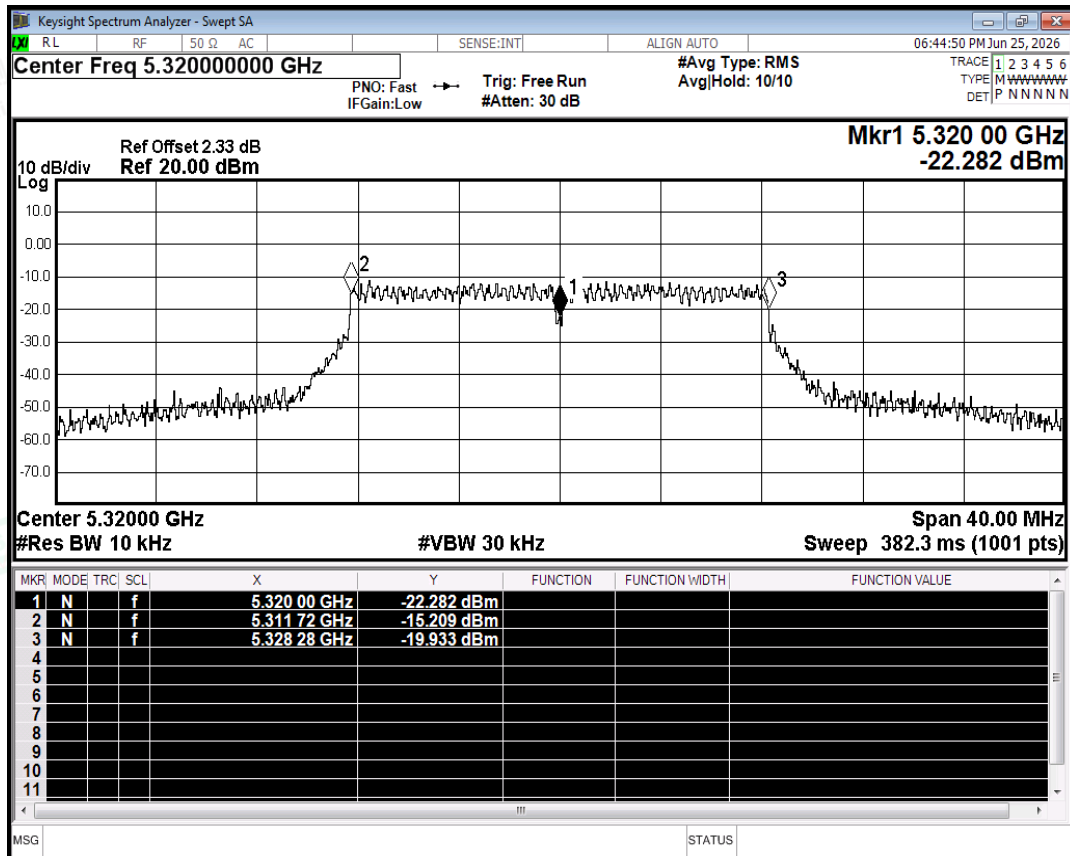

Freq. Stability NVNT a 5320MHz Ant1

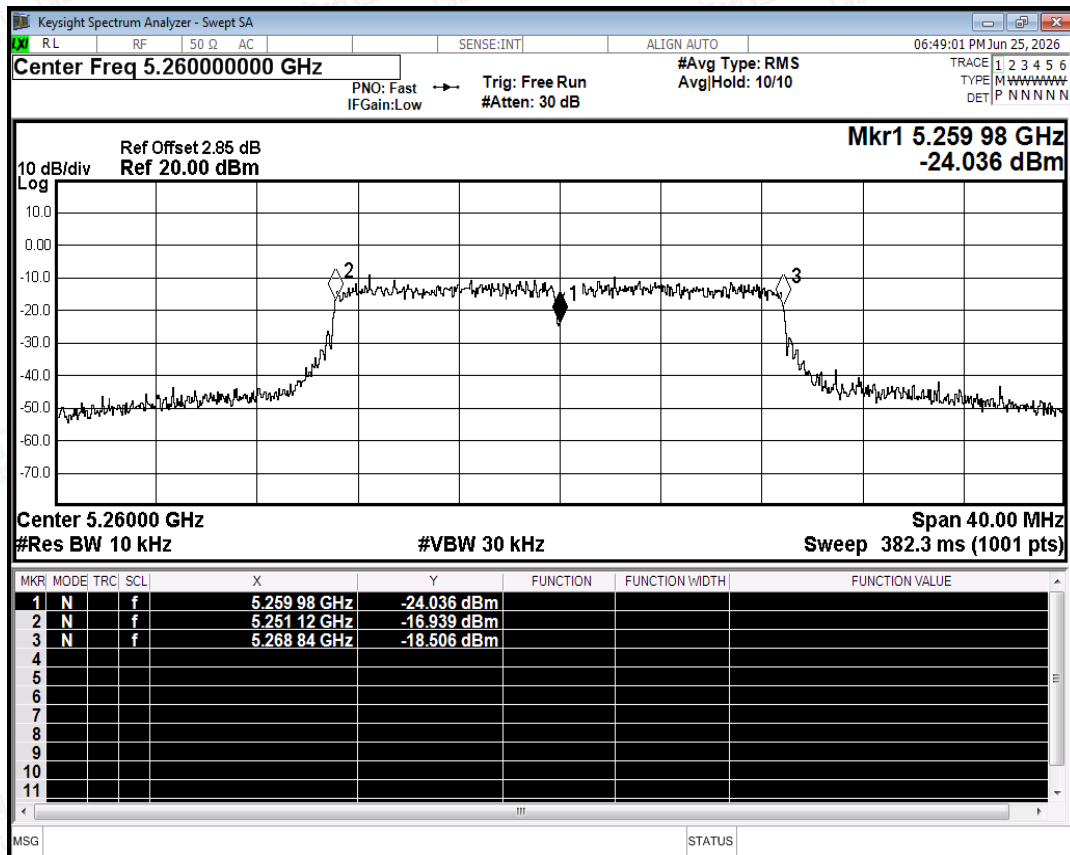

Freq. Stability NVNT n20 5260MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

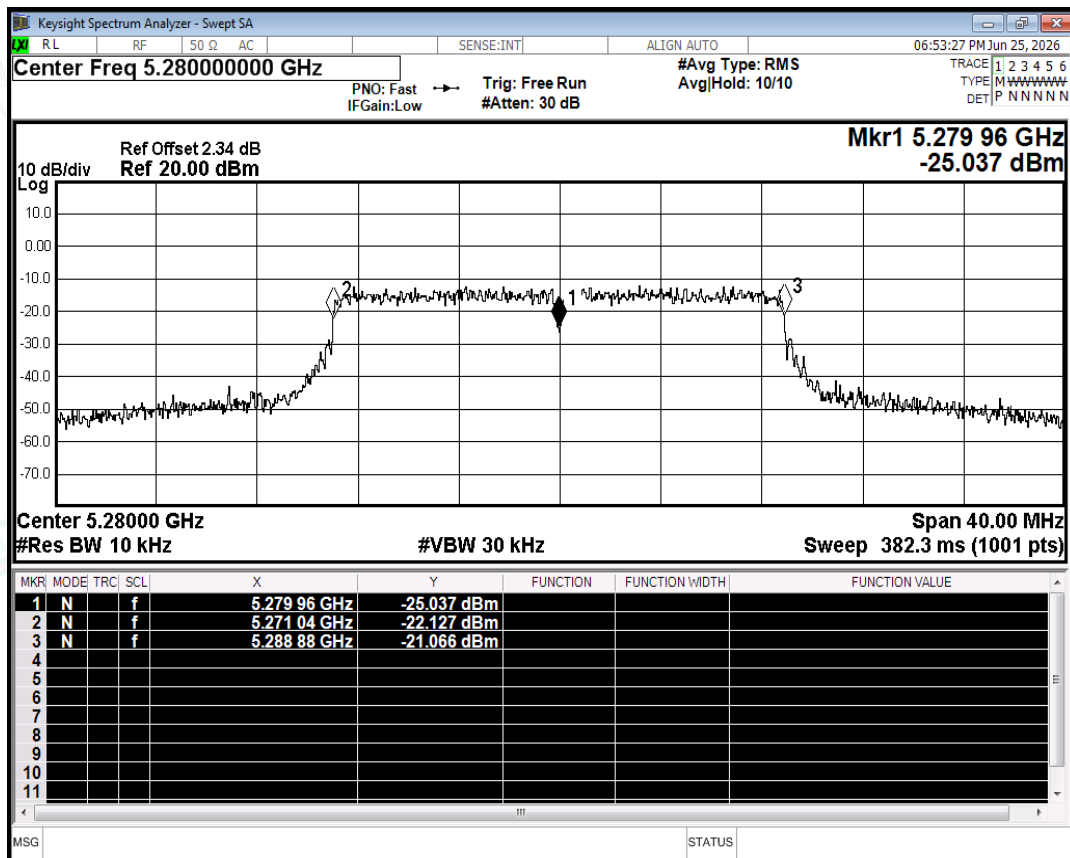

Freq. Stability NVNT n20 5280MHz Ant1

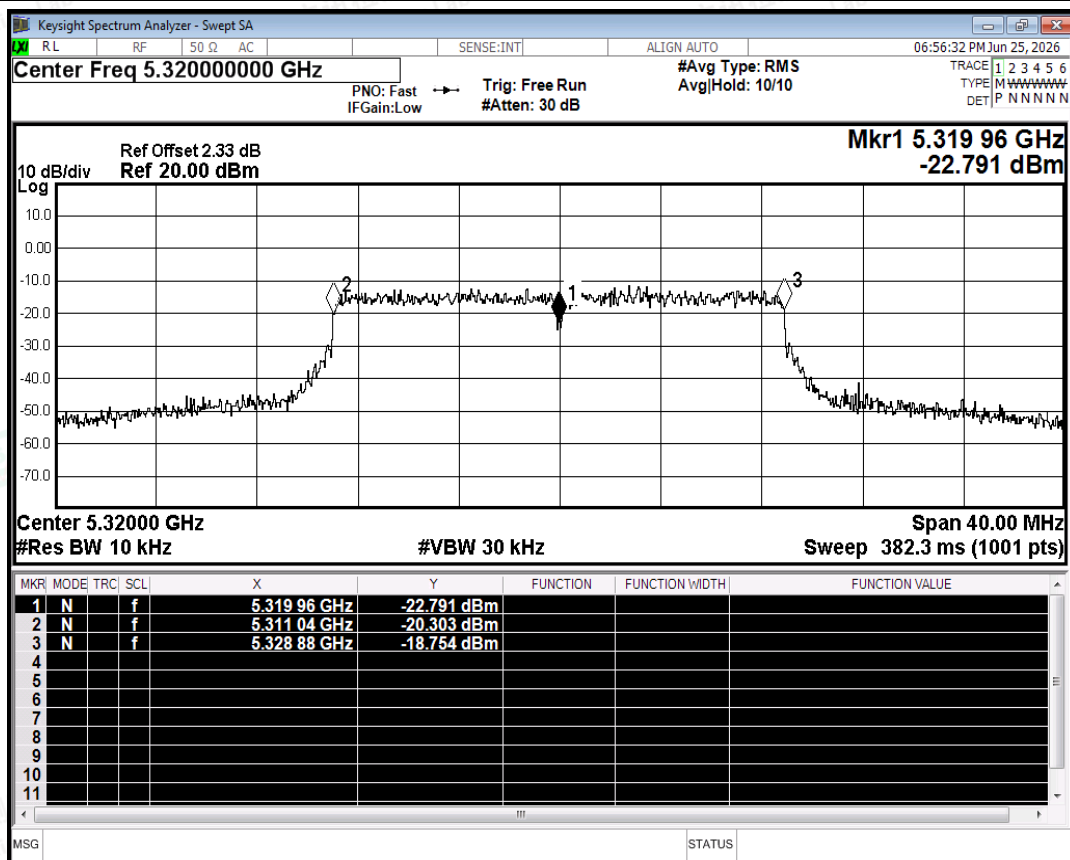

Freq. Stability NVNT n20 5320MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

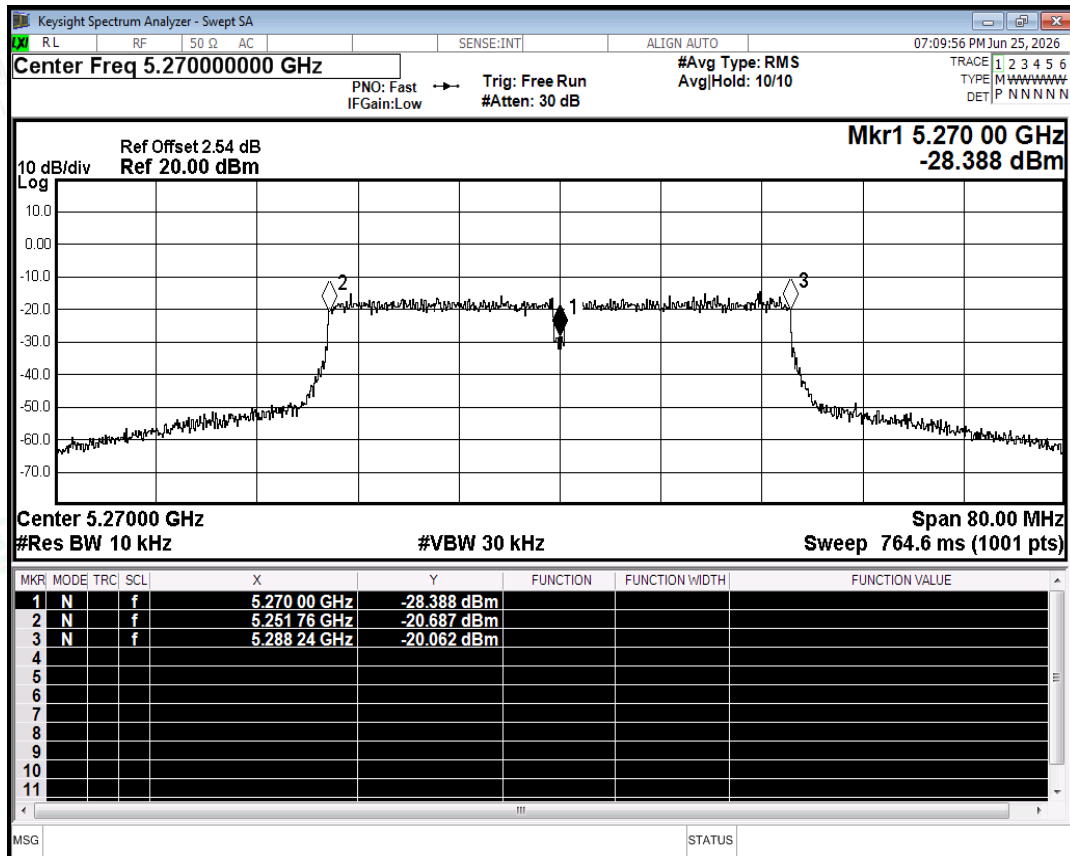

Freq. Stability NVNT n40 5270MHz Ant1

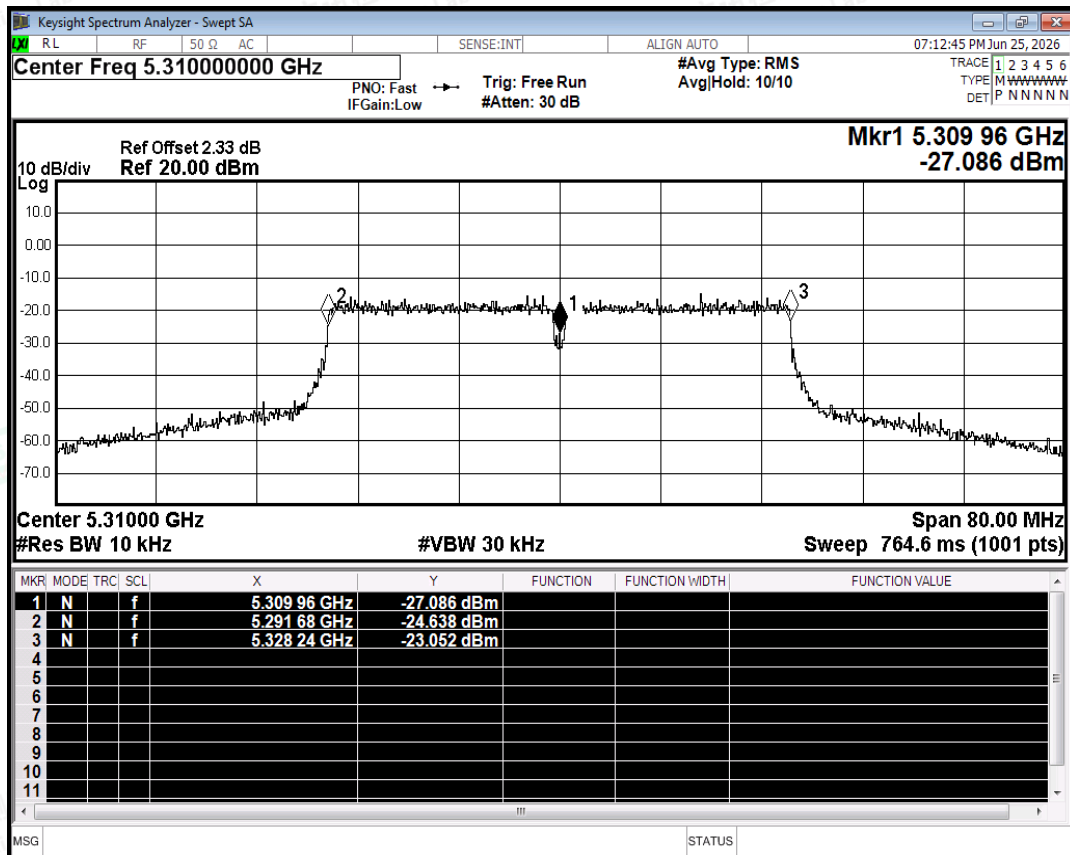

Freq. Stability NVNT n40 5310MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

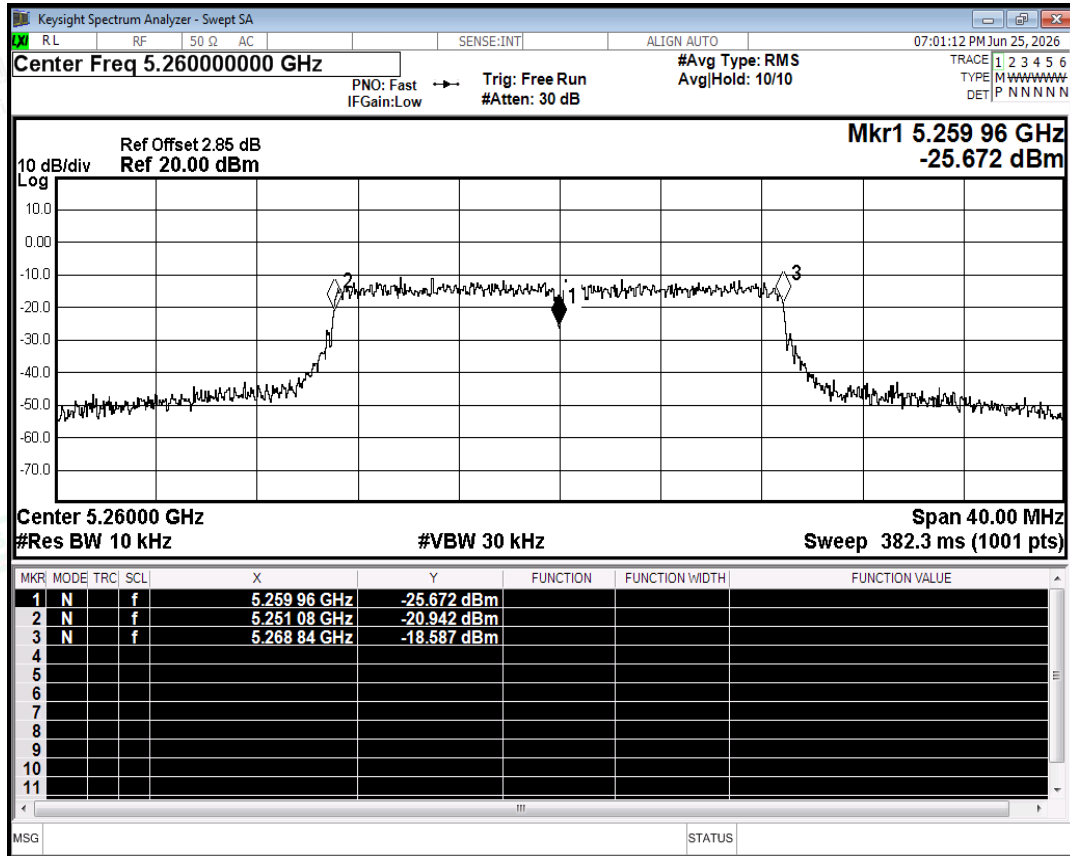

Freq. Stability NVNT ac20 5260MHz Ant1

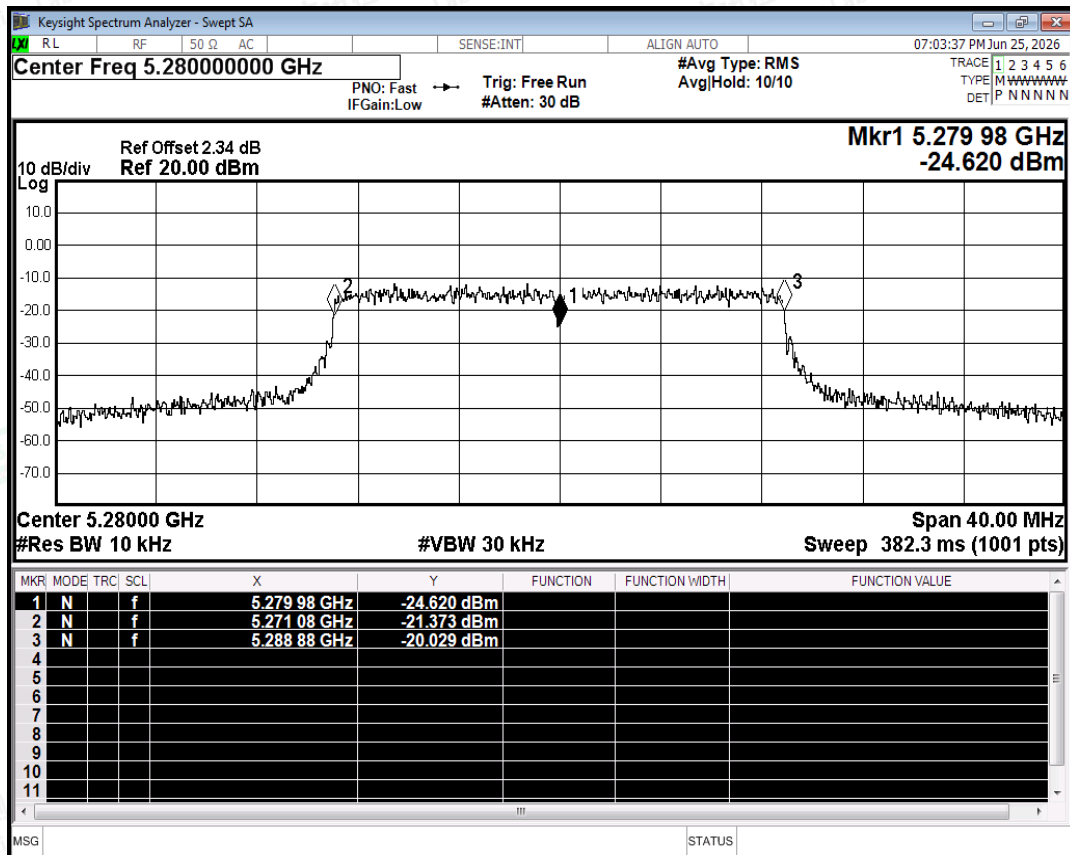

Freq. Stability NVNT ac20 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

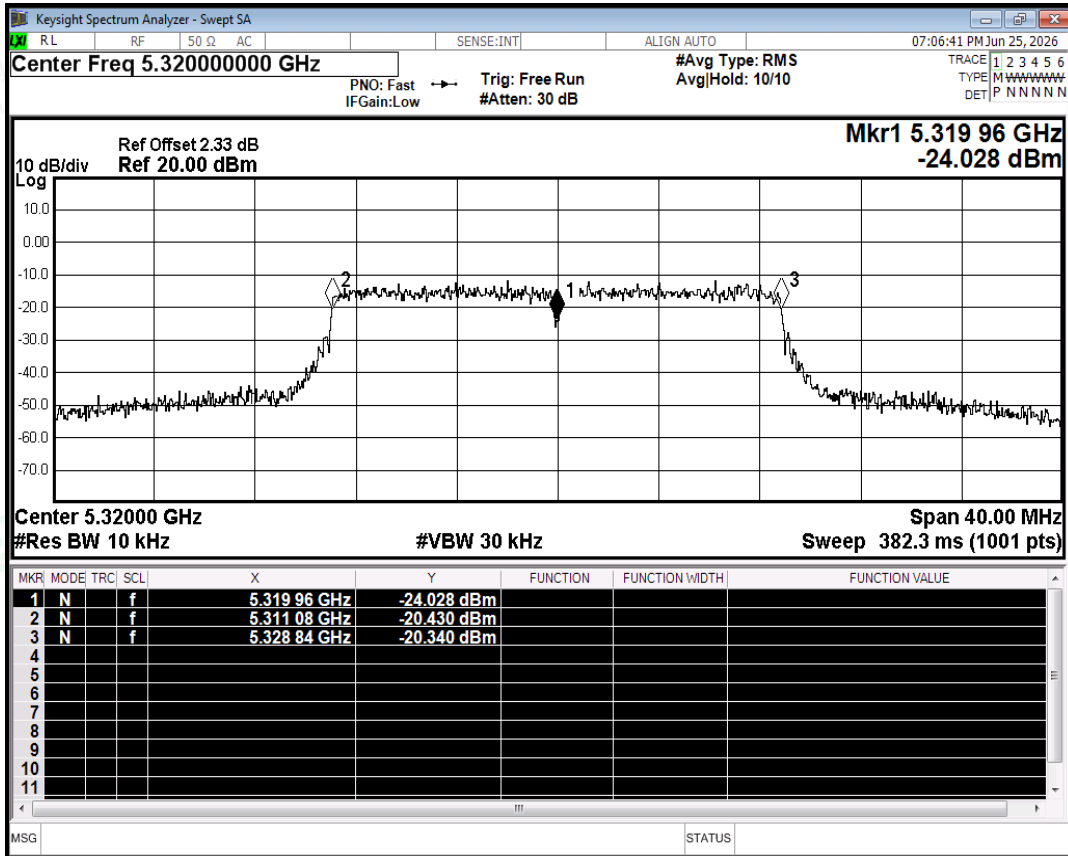

Freq. Stability NVNT ac20 5320MHz Ant1

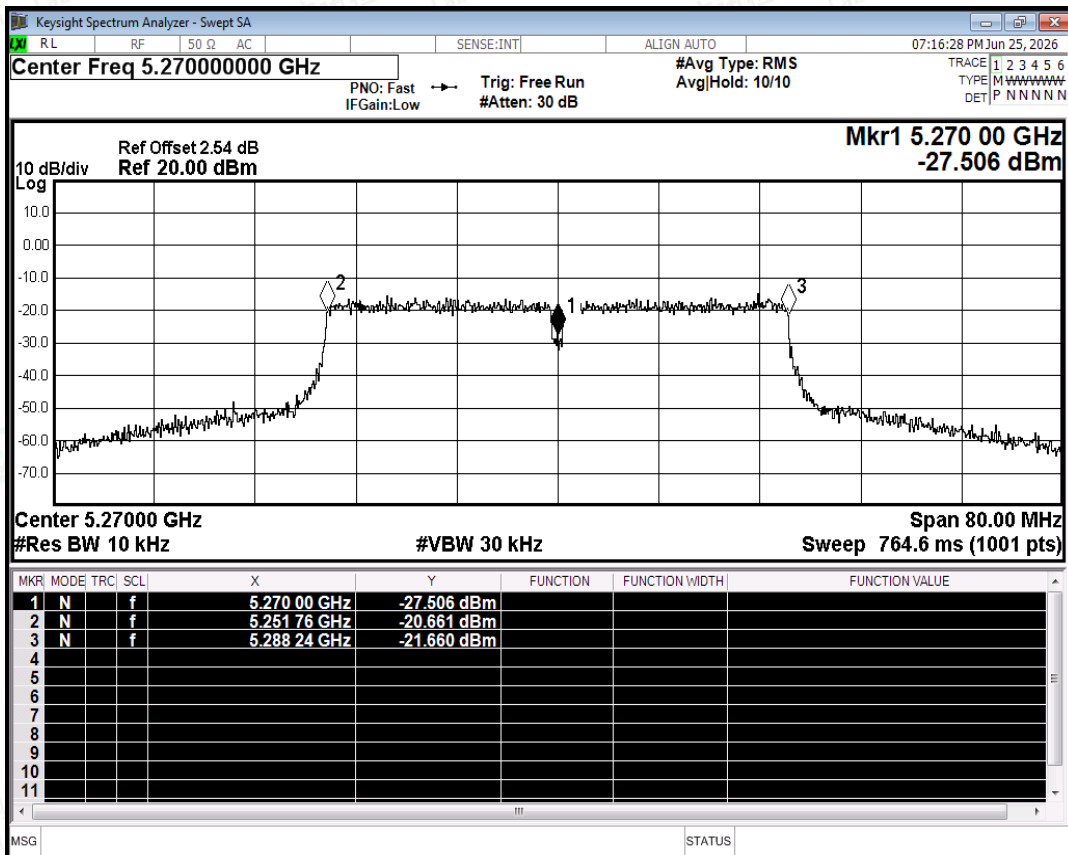

Freq. Stability NVNT ac40 5270MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

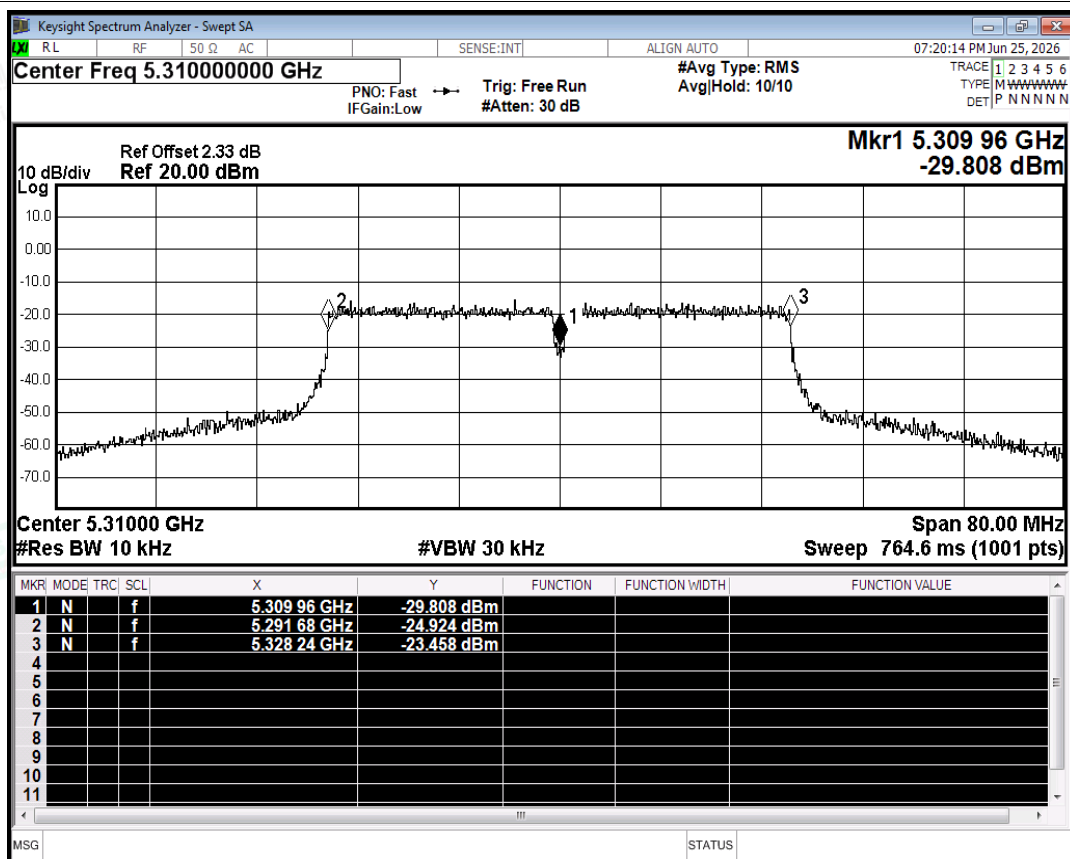

Freq. Stability NVNT ac40 5310MHz Ant1

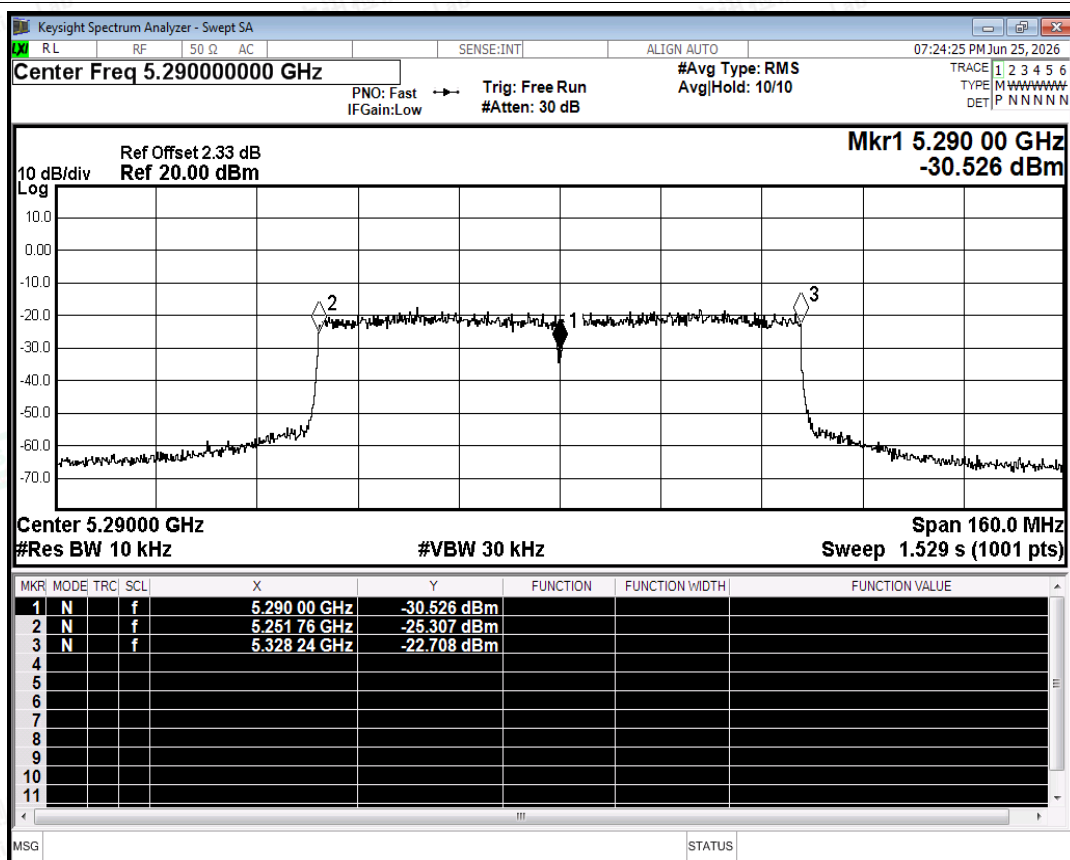

Freq. Stability NVNT ac80 5290MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



| Condition | Mode | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | a    | 5260            | Ant2    | 5259.98                  | -20000               | -3.8            | 25          | Pass    |
| NVNT      | a    | 5280            | Ant2    | 5279.98                  | -20000               | -3.79           | 25          | Pass    |
| NVNT      | a    | 5320            | Ant2    | 5319.98                  | -20000               | -3.76           | 25          | Pass    |
| NVNT      | n20  | 5260            | Ant2    | 5259.98                  | -20000               | -3.8            | 25          | Pass    |
| NVNT      | n20  | 5280            | Ant2    | 5279.98                  | -20000               | -3.79           | 25          | Pass    |
| NVNT      | n20  | 5320            | Ant2    | 5319.98                  | -20000               | -3.76           | 25          | Pass    |
| NVNT      | n40  | 5270            | Ant2    | 5269.96                  | -40000               | -7.59           | 25          | Pass    |
| NVNT      | n40  | 5310            | Ant2    | 5309.96                  | -40000               | -7.53           | 25          | Pass    |
| NVNT      | ac20 | 5260            | Ant2    | 5260                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac20 | 5280            | Ant2    | 5279.96                  | -40000               | -7.58           | 25          | Pass    |
| NVNT      | ac20 | 5320            | Ant2    | 5319.98                  | -20000               | -3.76           | 25          | Pass    |
| NVNT      | ac40 | 5270            | Ant2    | 5269.96                  | -40000               | -7.59           | 25          | Pass    |
| NVNT      | ac40 | 5310            | Ant2    | 5310                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac80 | 5290            | Ant2    | 5290                     | 0                    | 0               | 25          | Pass    |




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

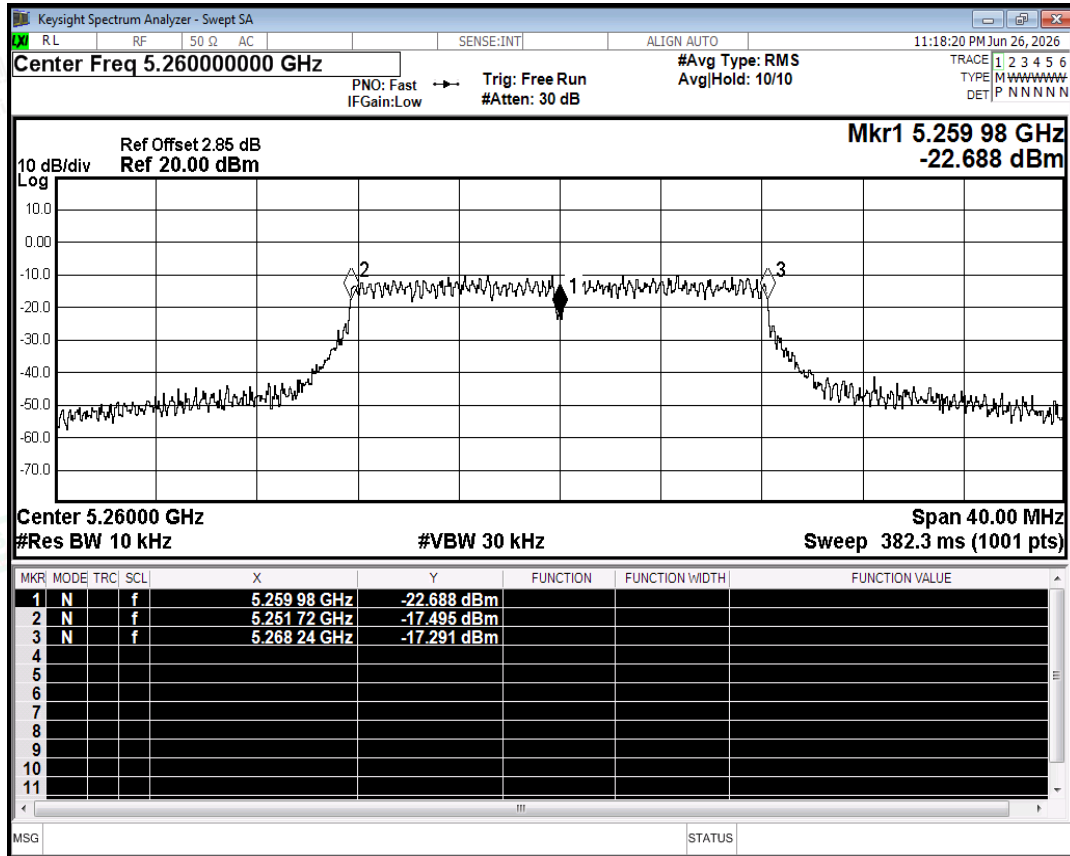

Freq. Stability NVNT a 5260MHz Ant2

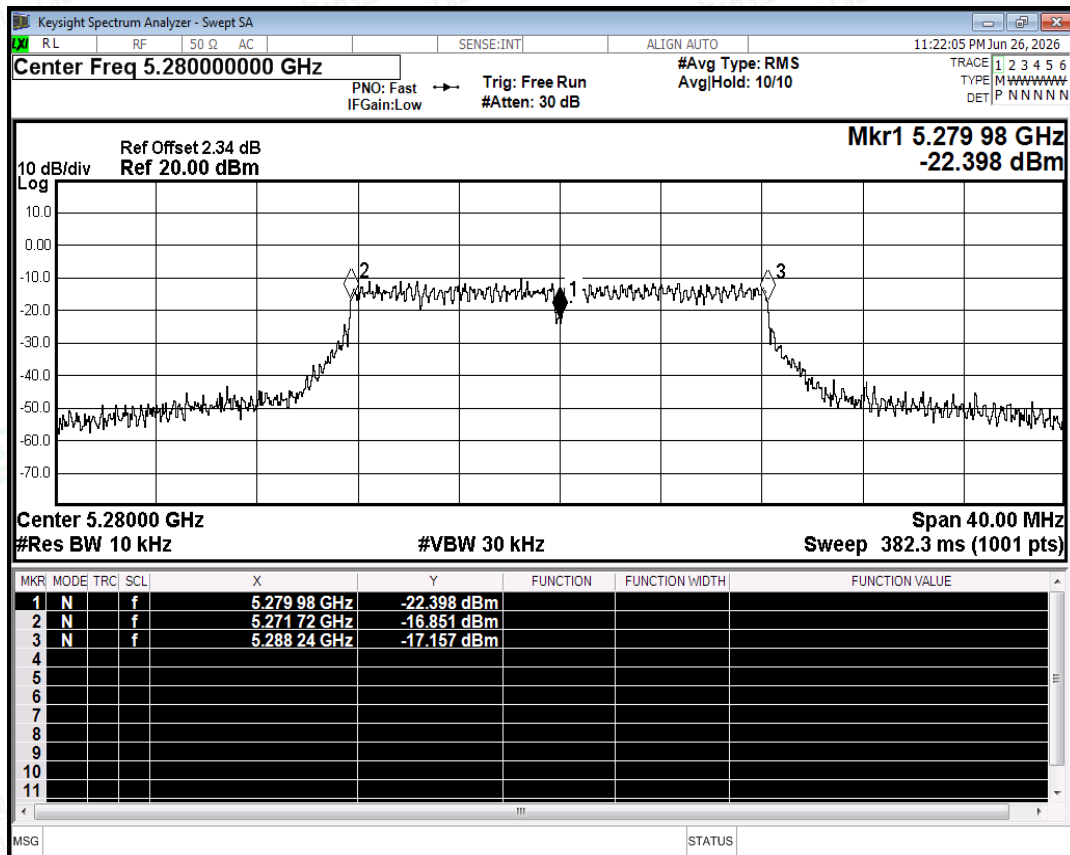

Freq. Stability NVNT a 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

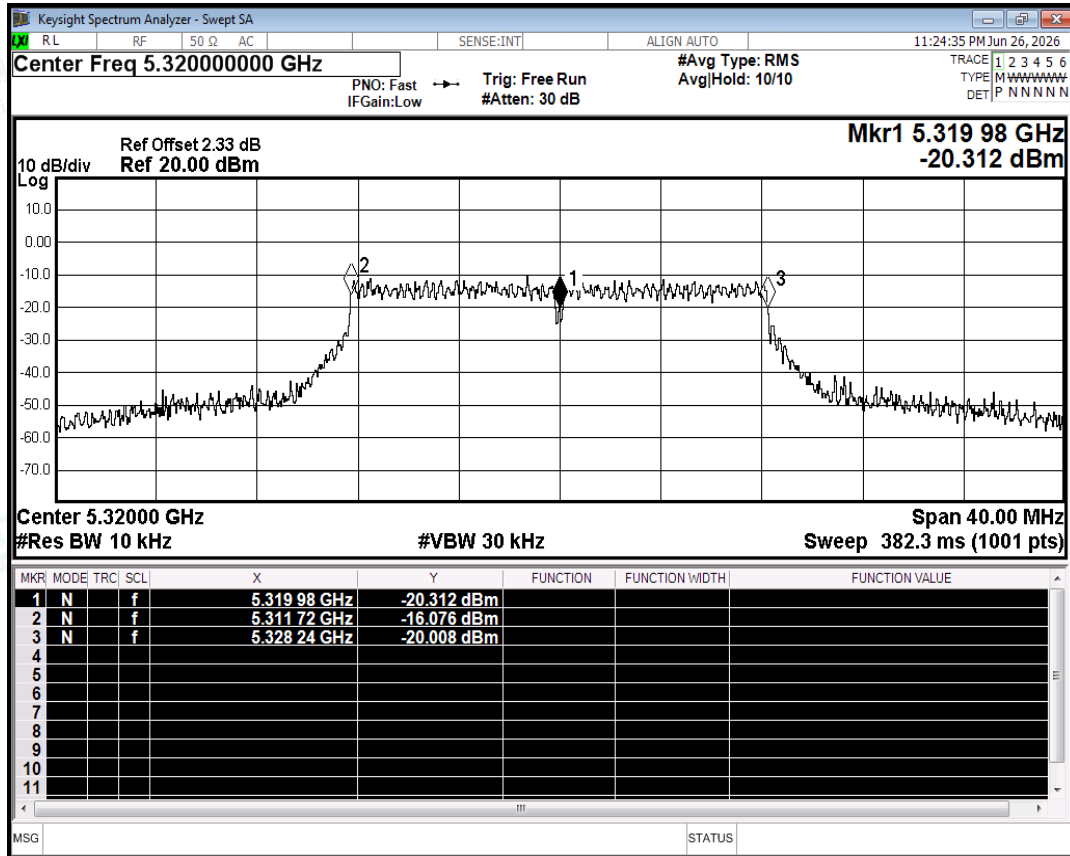

Freq. Stability NVNT a 5320MHz Ant2

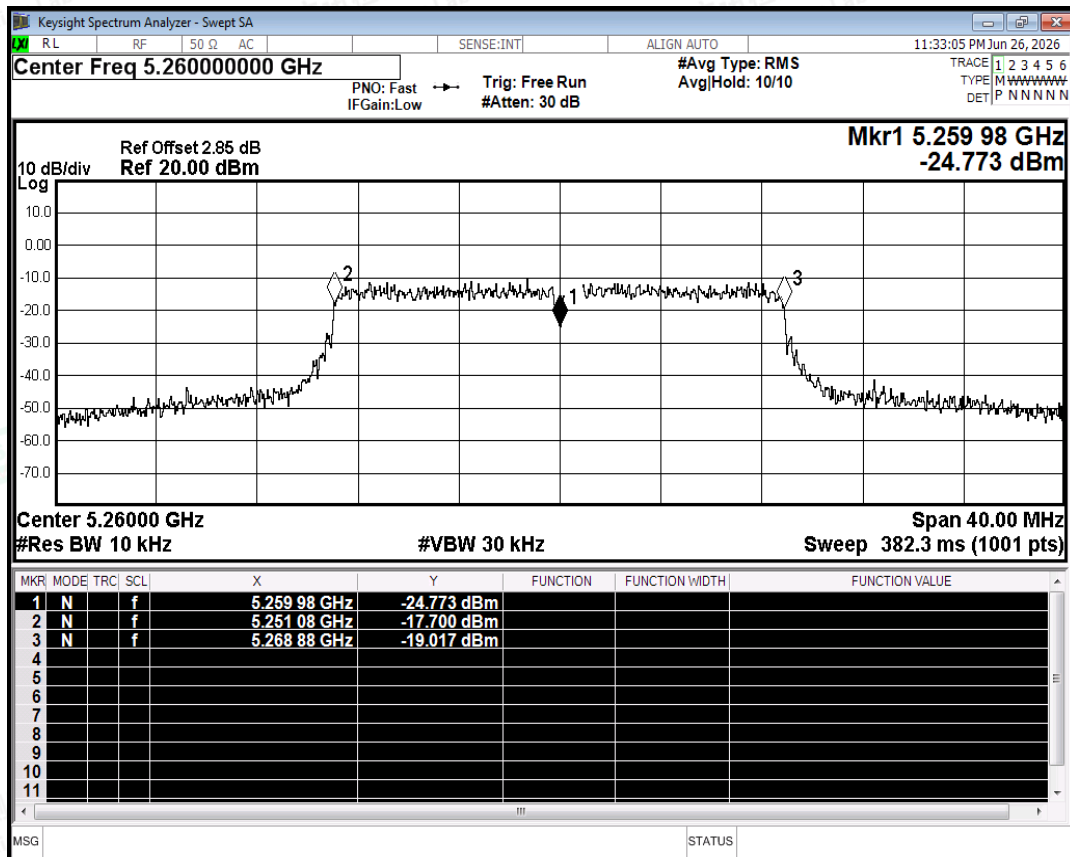

Freq. Stability NVNT n20 5260MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

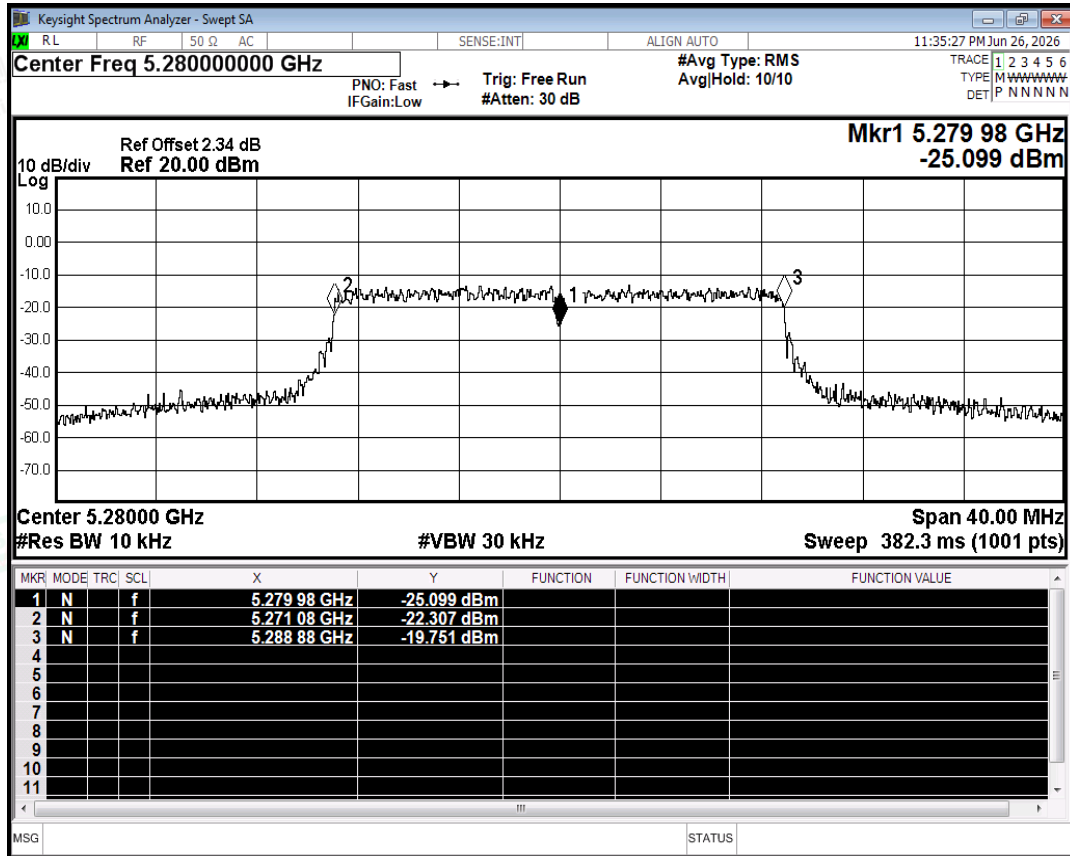

Freq. Stability NVNT n20 5280MHz Ant2

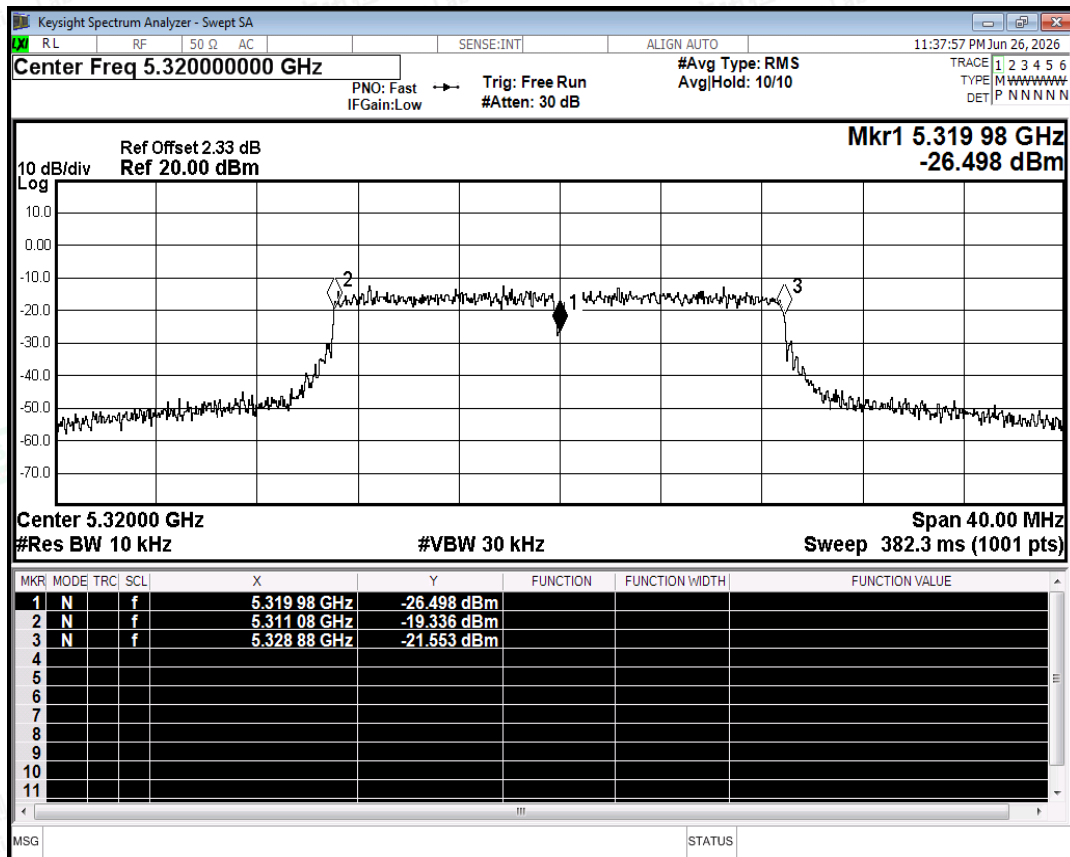

Freq. Stability NVNT n20 5320MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

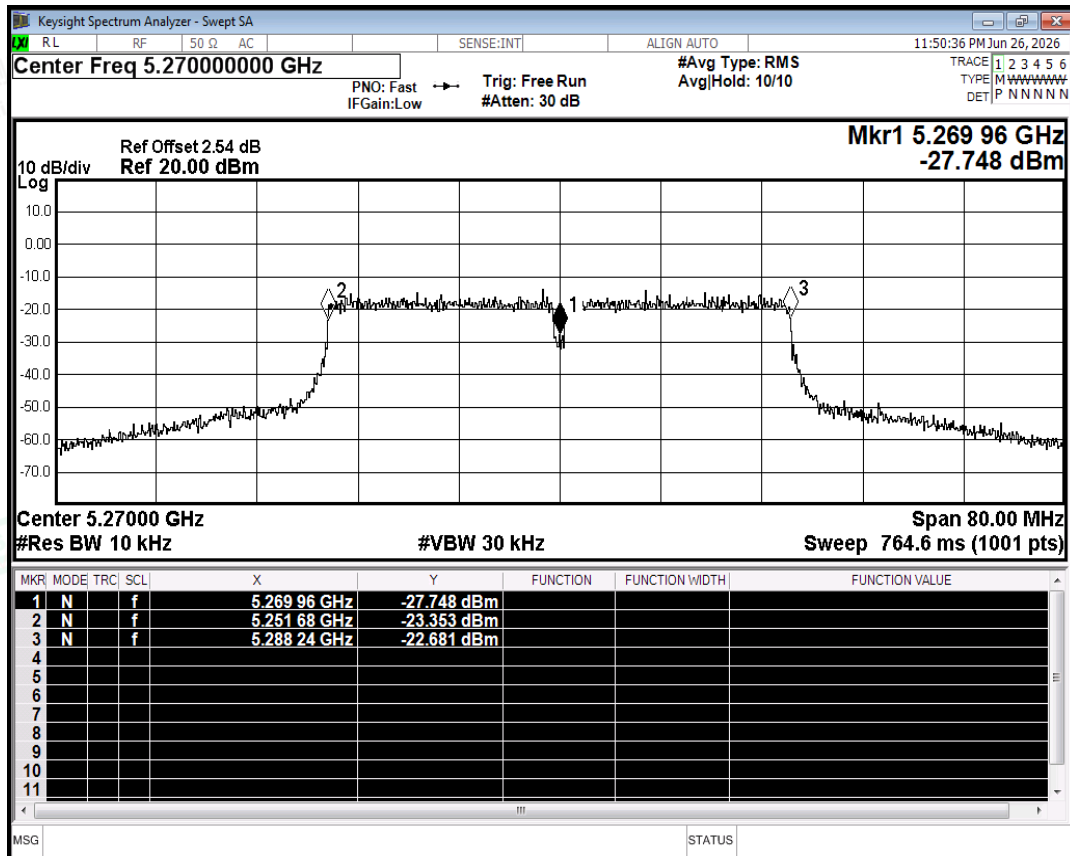

Freq. Stability NVNT n40 5270MHz Ant2

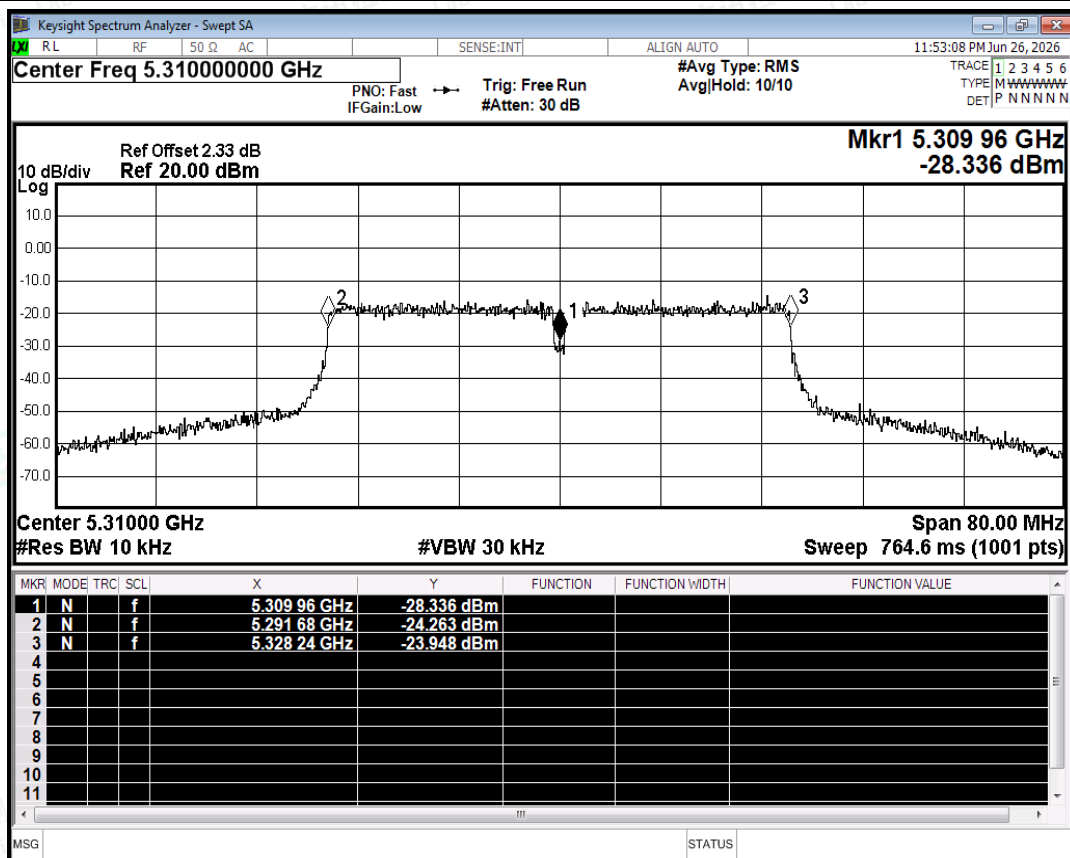

Freq. Stability NVNT n40 5310MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

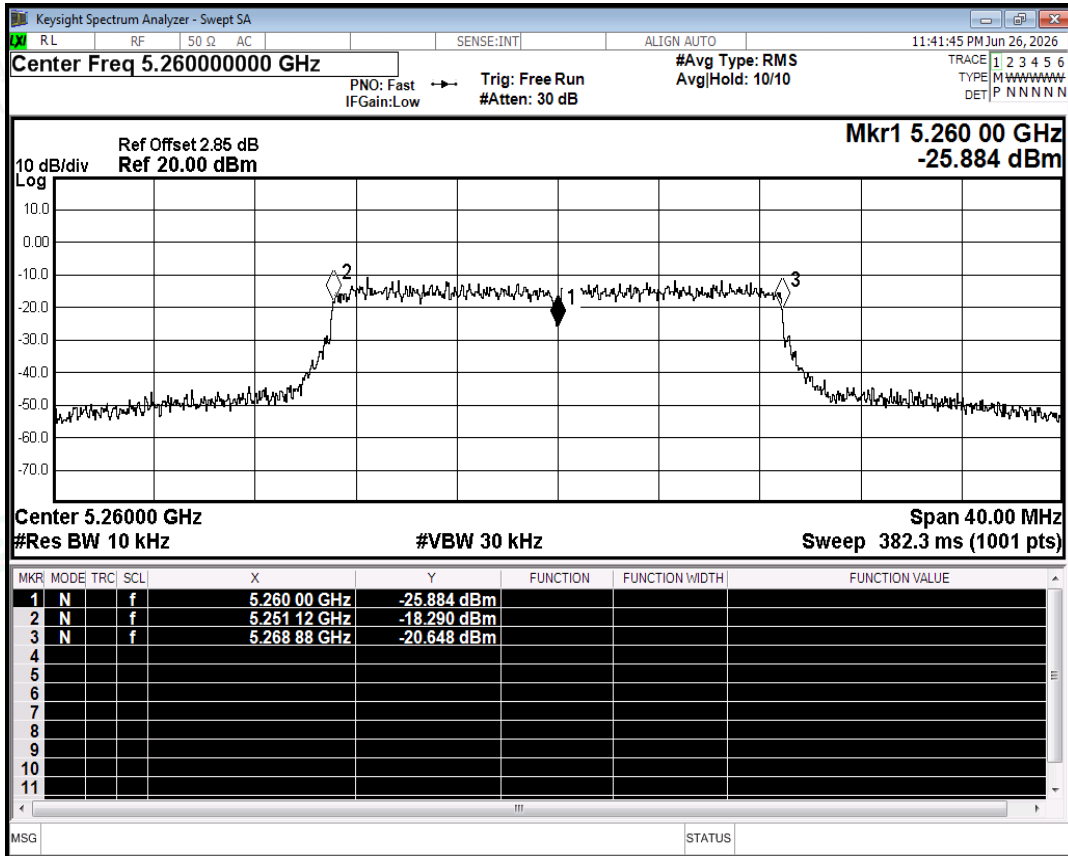

Freq. Stability NVNT ac20 5260MHz Ant2

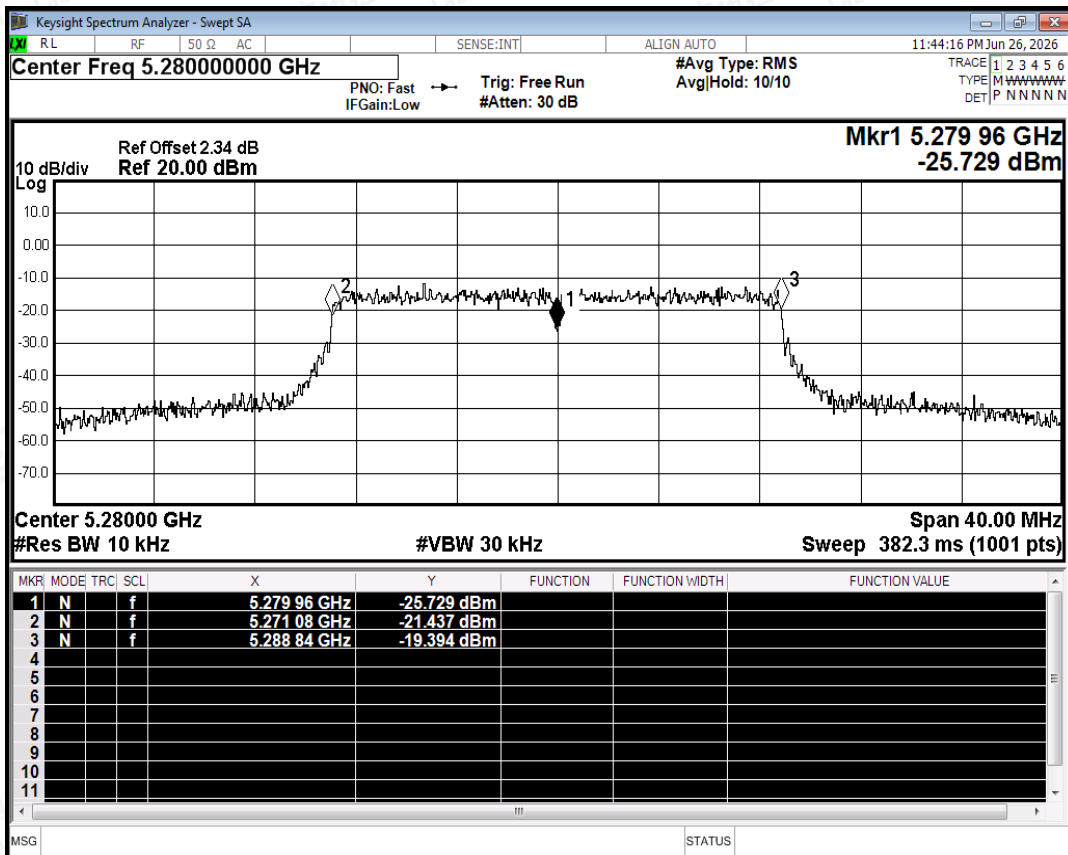

Freq. Stability NVNT ac20 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

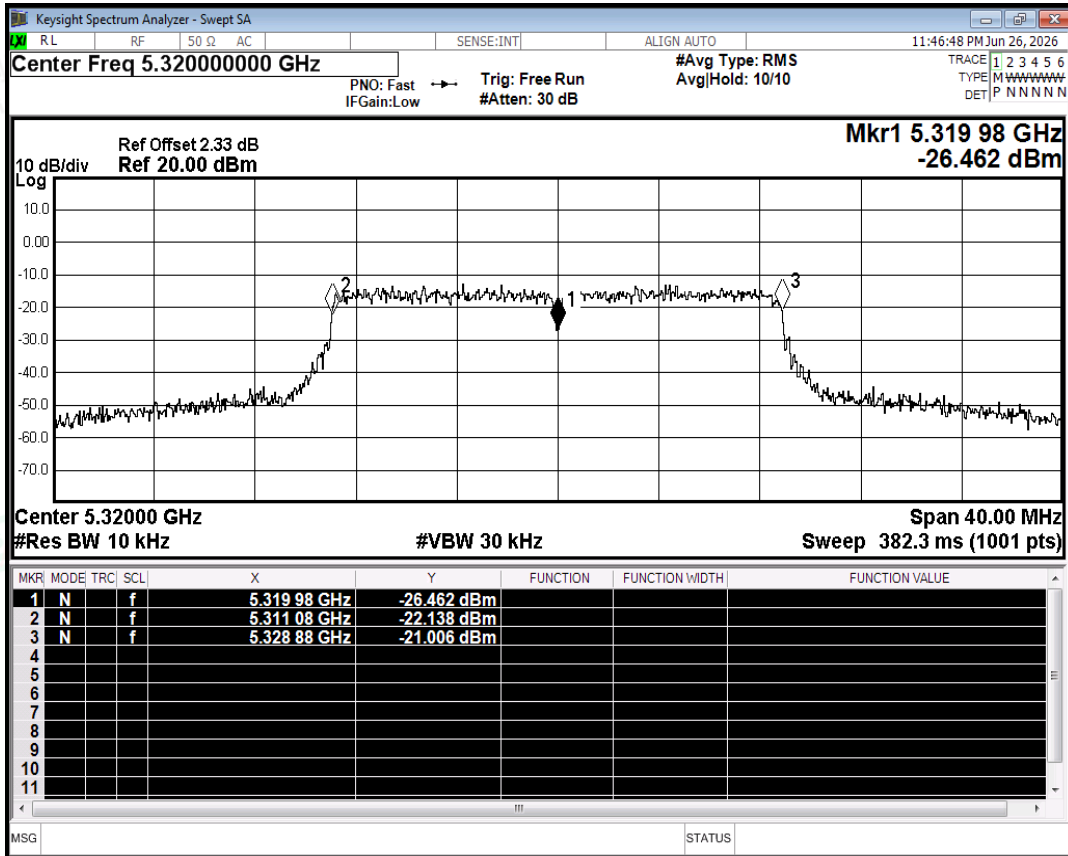

Freq. Stability NVNT ac20 5320MHz Ant2

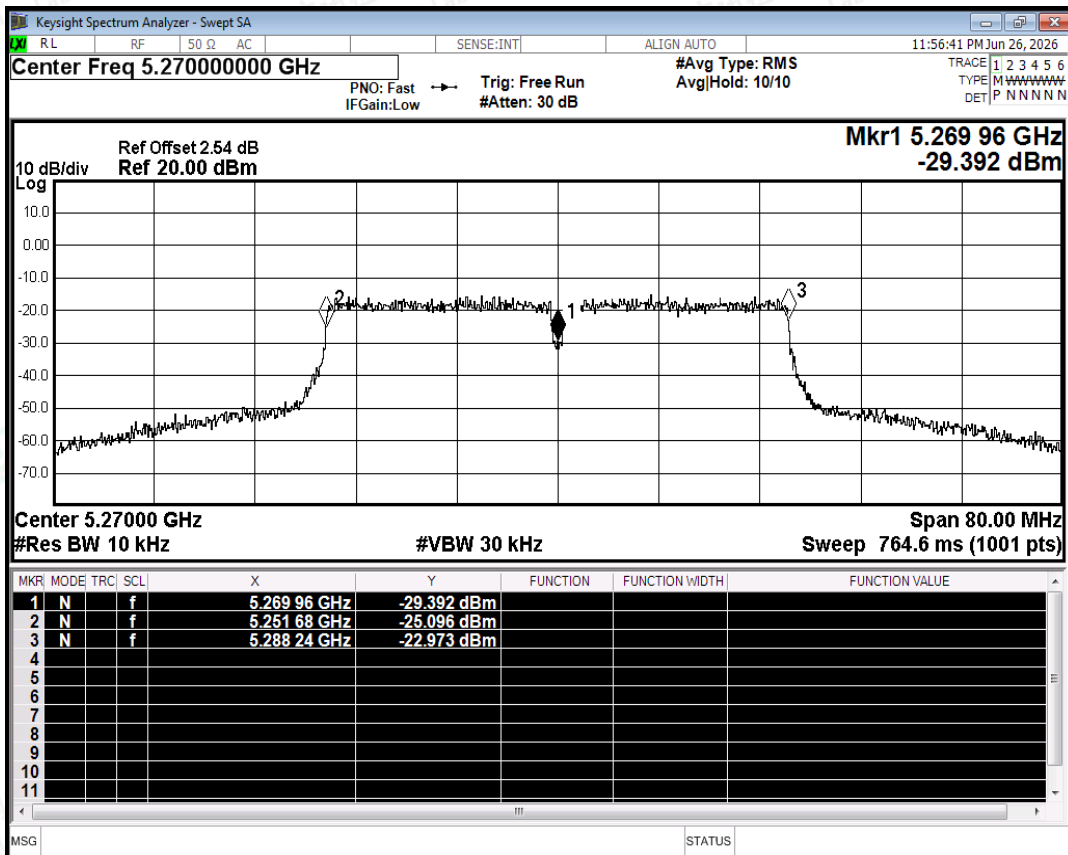

Freq. Stability NVNT ac40 5270MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

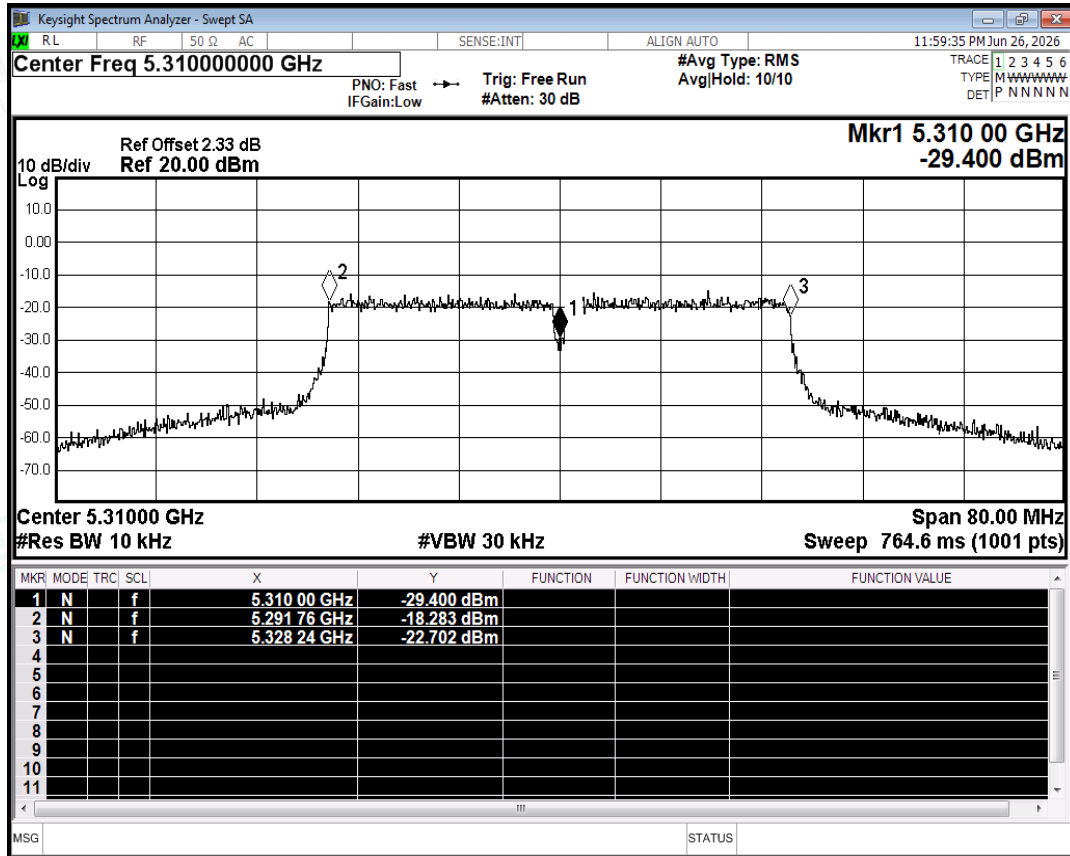

Freq. Stability NVNT ac40 5310MHz Ant2

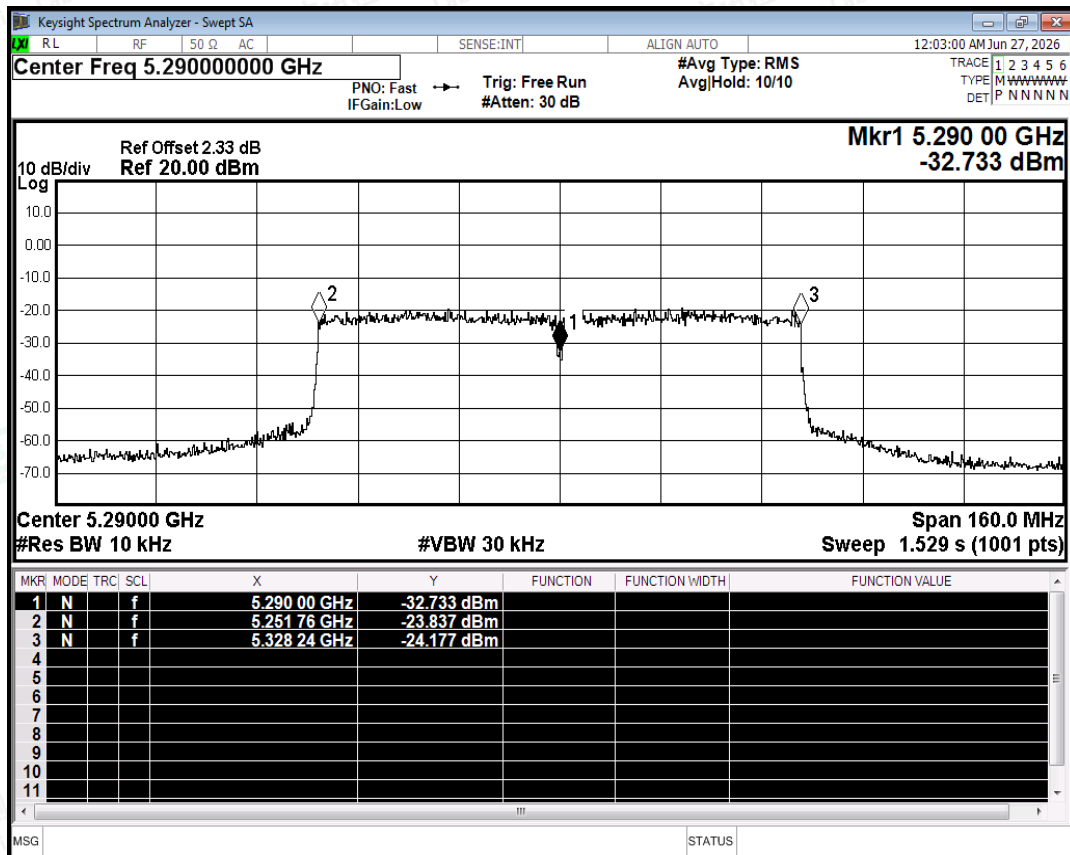

Freq. Stability NVNT ac80 5290MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## C.6 Duty Cycle

| Condition | Mode | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a    | 5260            | Ant1    | 97.83          | 0.1                    | 0.37      |
| NVNT      | a    | 5280            | Ant1    | 97.83          | 0.1                    | 0.37      |
| NVNT      | a    | 5320            | Ant1    | 97.83          | 0.1                    | 0.37      |
| NVNT      | n20  | 5260            | Ant1    | 97.42          | 0.11                   | 0.44      |
| NVNT      | n20  | 5280            | Ant1    | 97.41          | 0.11                   | 0.44      |
| NVNT      | n20  | 5320            | Ant1    | 97.41          | 0.11                   | 0.44      |
| NVNT      | n40  | 5270            | Ant1    | 94.87          | 0.23                   | 0.9       |
| NVNT      | n40  | 5310            | Ant1    | 94.02          | 0.27                   | 0.91      |
| NVNT      | ac20 | 5260            | Ant1    | 97.42          | 0.11                   | 0.44      |
| NVNT      | ac20 | 5280            | Ant1    | 97.01          | 0.13                   | 0.44      |
| NVNT      | ac20 | 5320            | Ant1    | 97.42          | 0.11                   | 0.44      |
| NVNT      | ac40 | 5270            | Ant1    | 94.07          | 0.27                   | 0.9       |
| NVNT      | ac40 | 5310            | Ant1    | 94.07          | 0.27                   | 0.9       |
| NVNT      | ac80 | 5290            | Ant1    | 90             | 0.46                   | 1.85      |




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

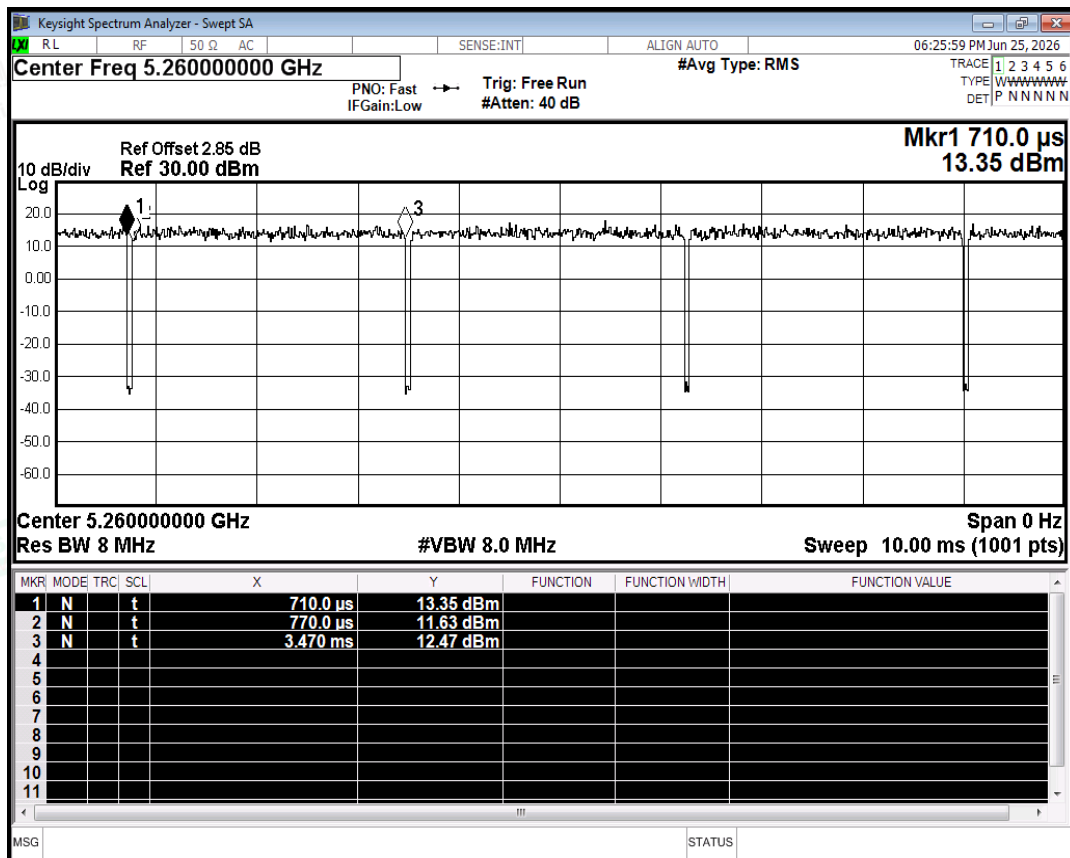

Duty Cycle NVNT a 5260MHz Ant1

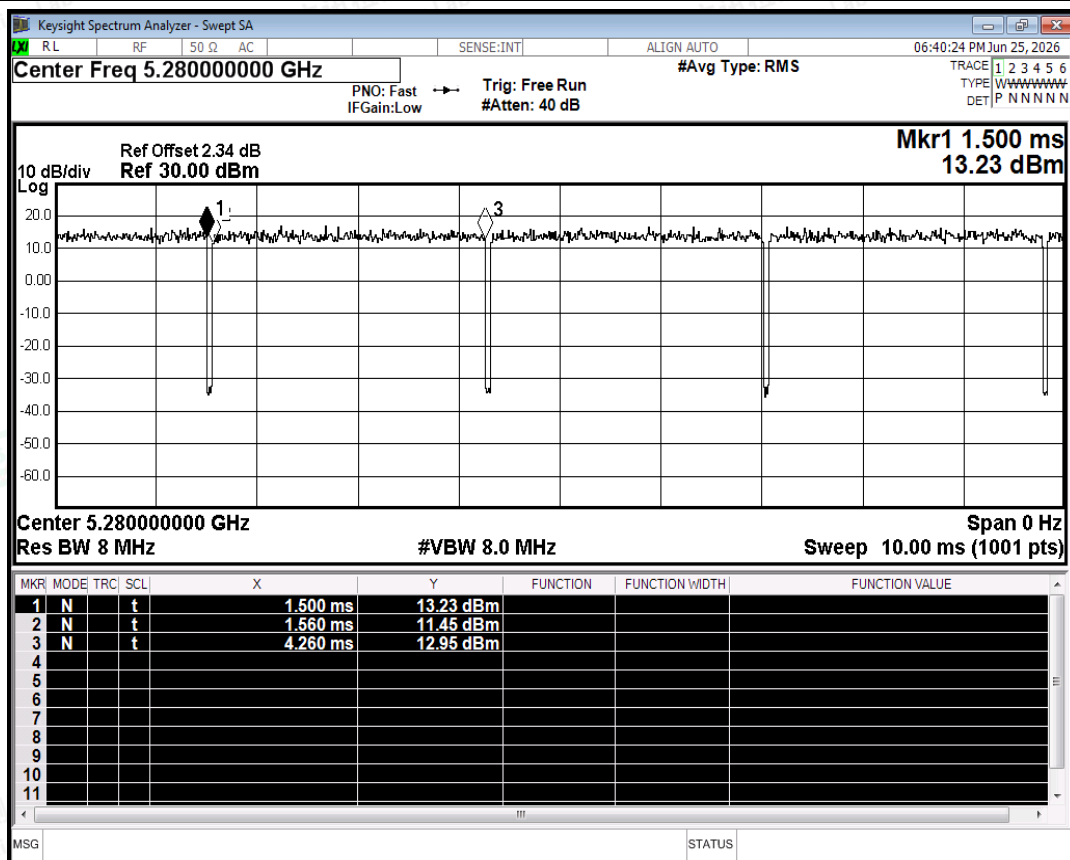

Duty Cycle NVNT a 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

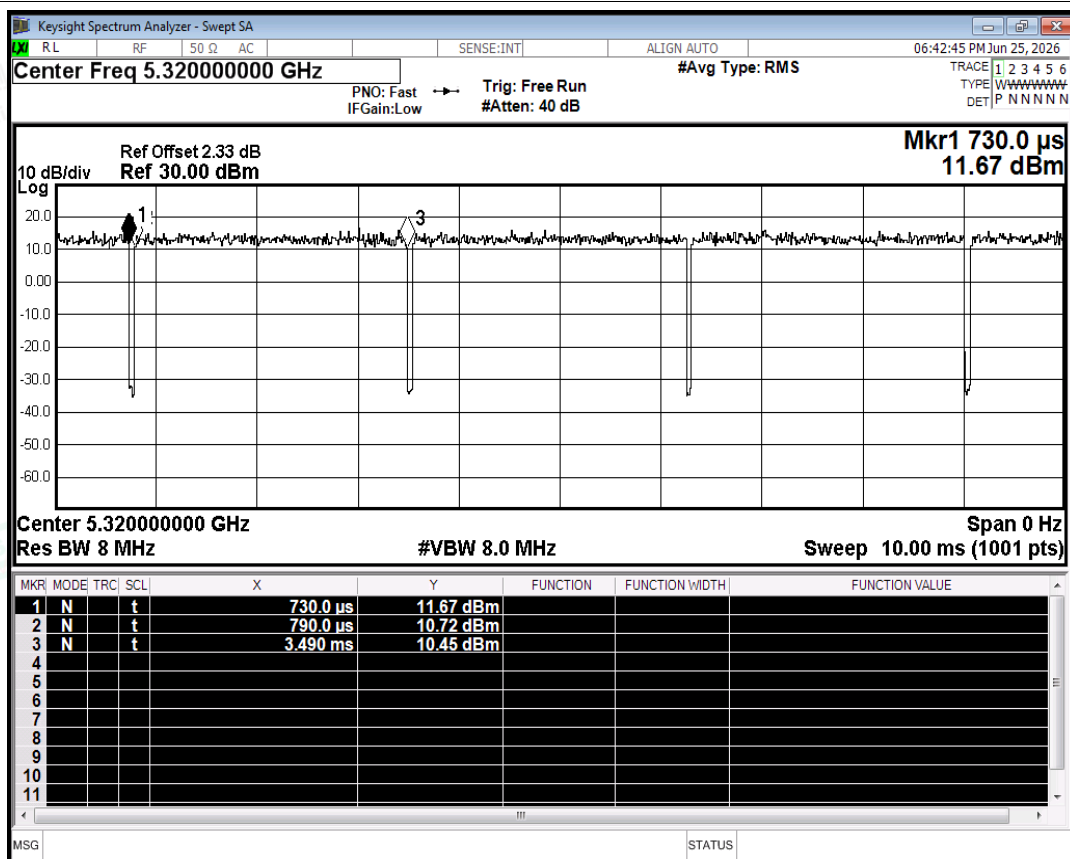

Duty Cycle NVNT a 5320MHz Ant1

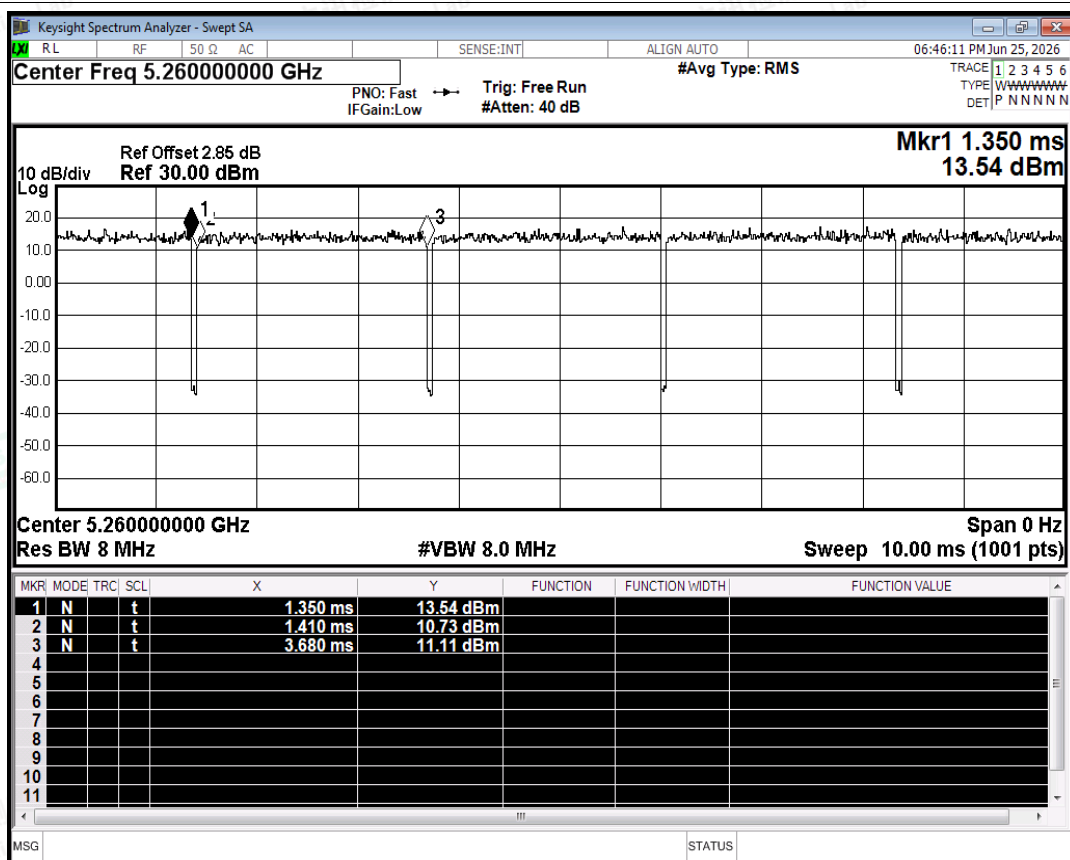

Duty Cycle NVNT n20 5260MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

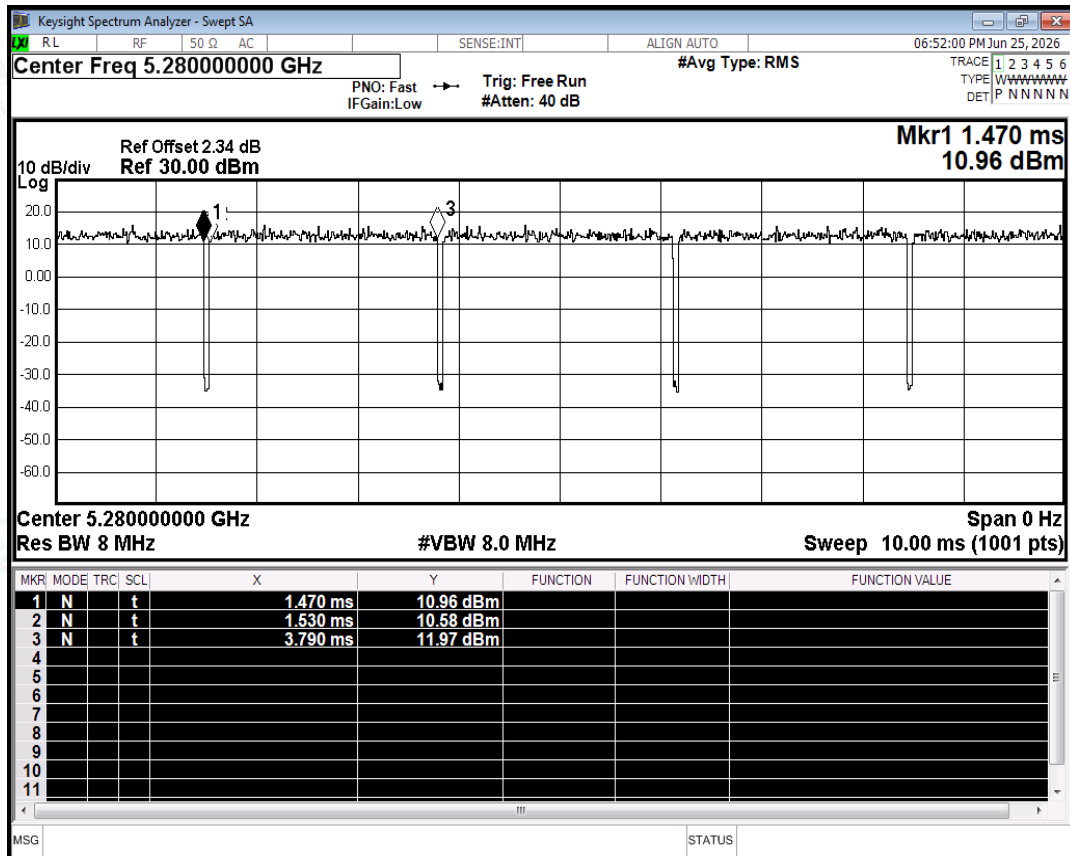

Duty Cycle NVNT n20 5280MHz Ant1

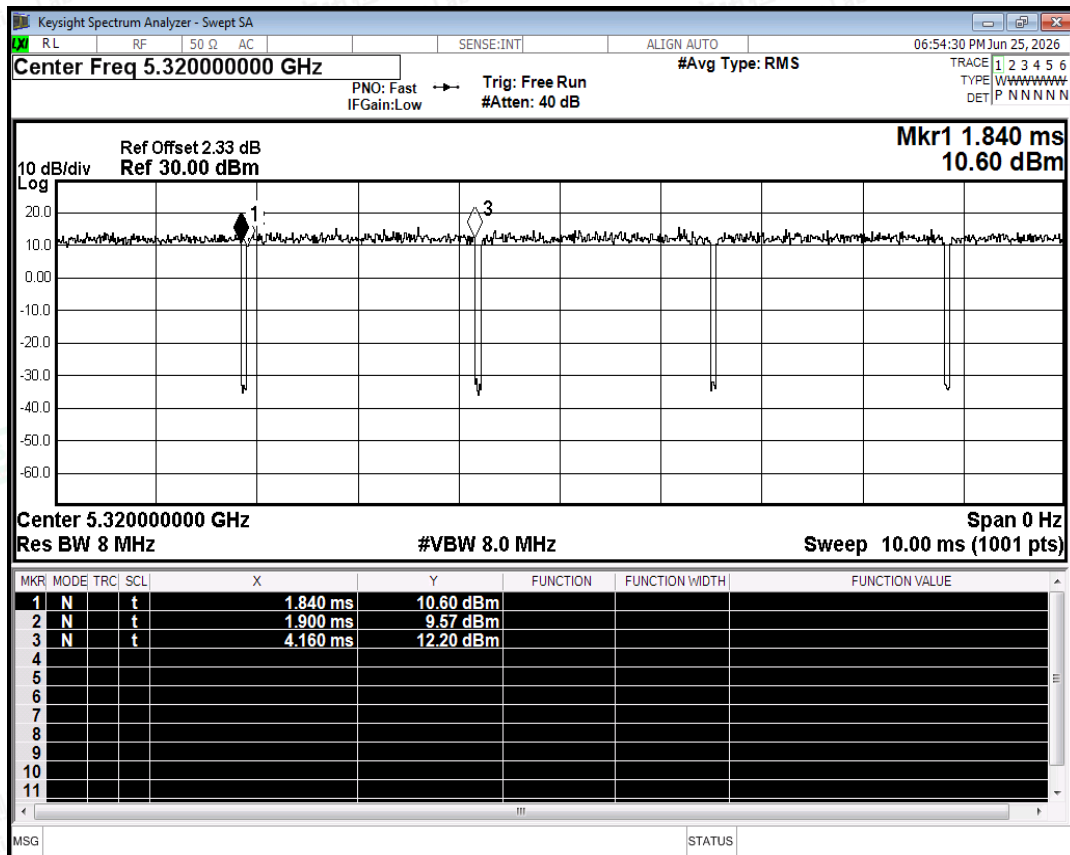

Duty Cycle NVNT n20 5320MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

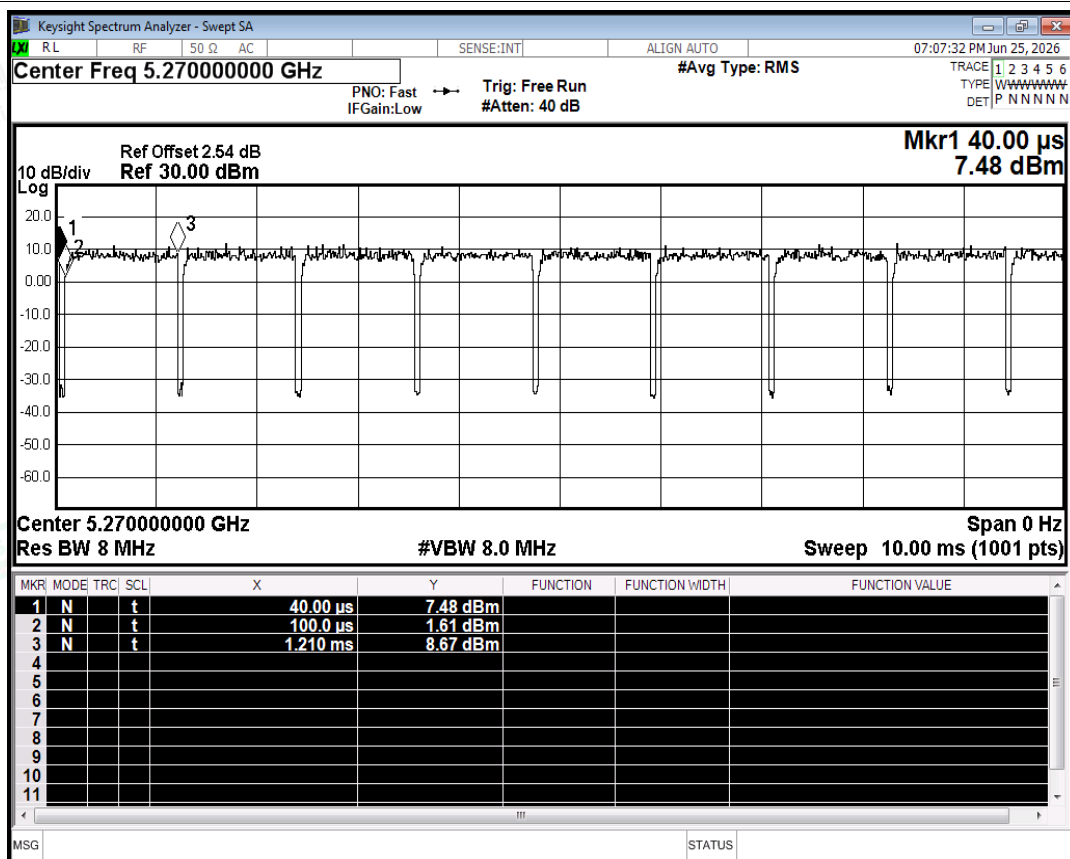

Duty Cycle NVNT n40 5270MHz Ant1

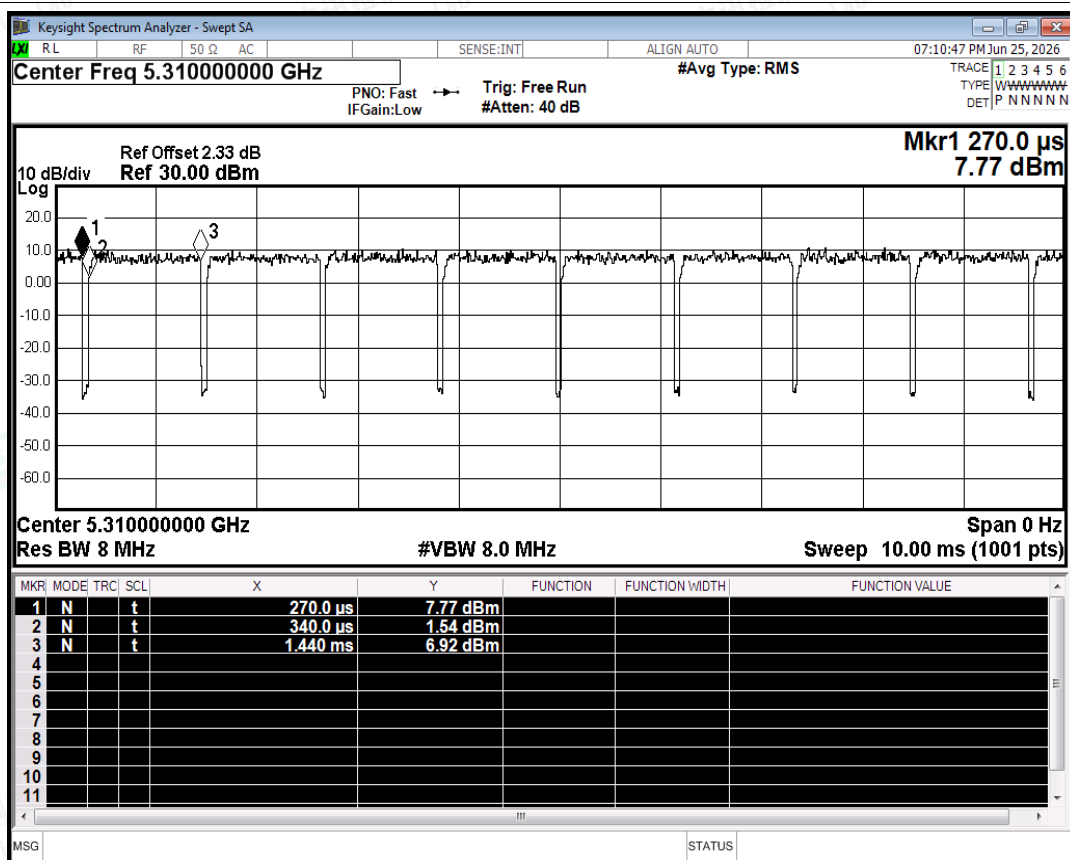

Duty Cycle NVNT n40 5310MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

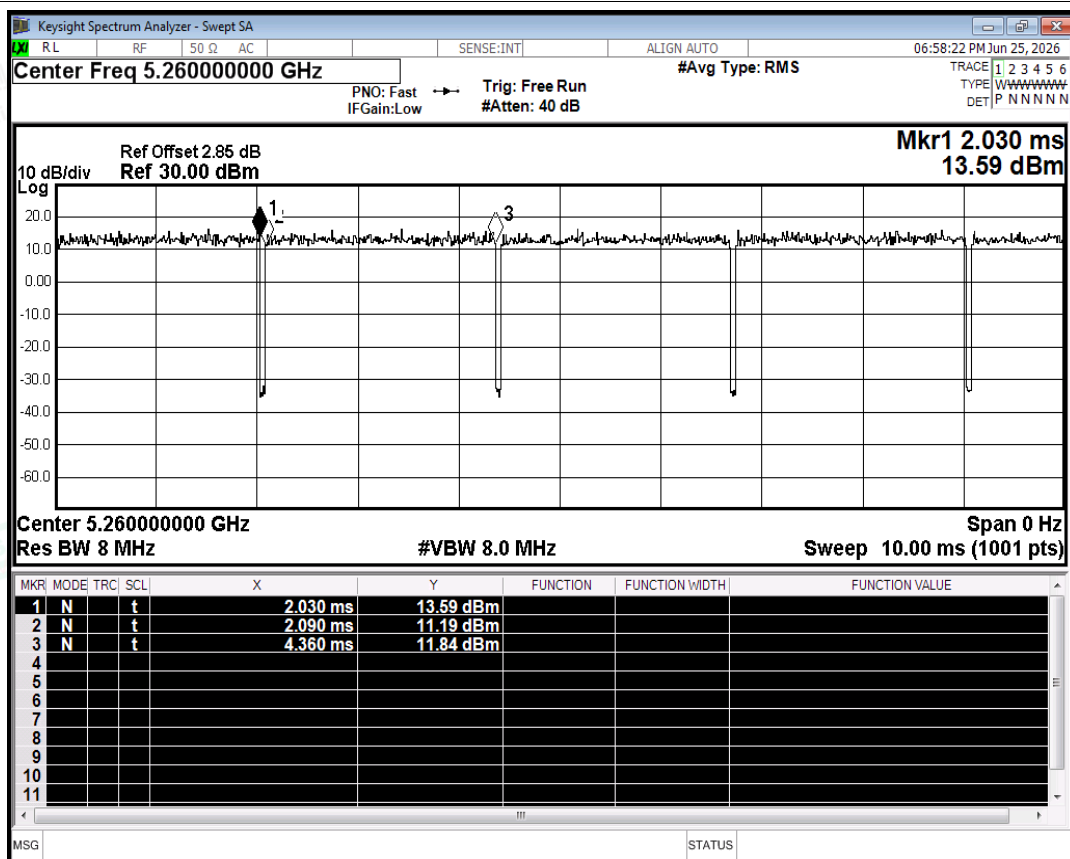

Duty Cycle NVNT ac20 5260MHz Ant1

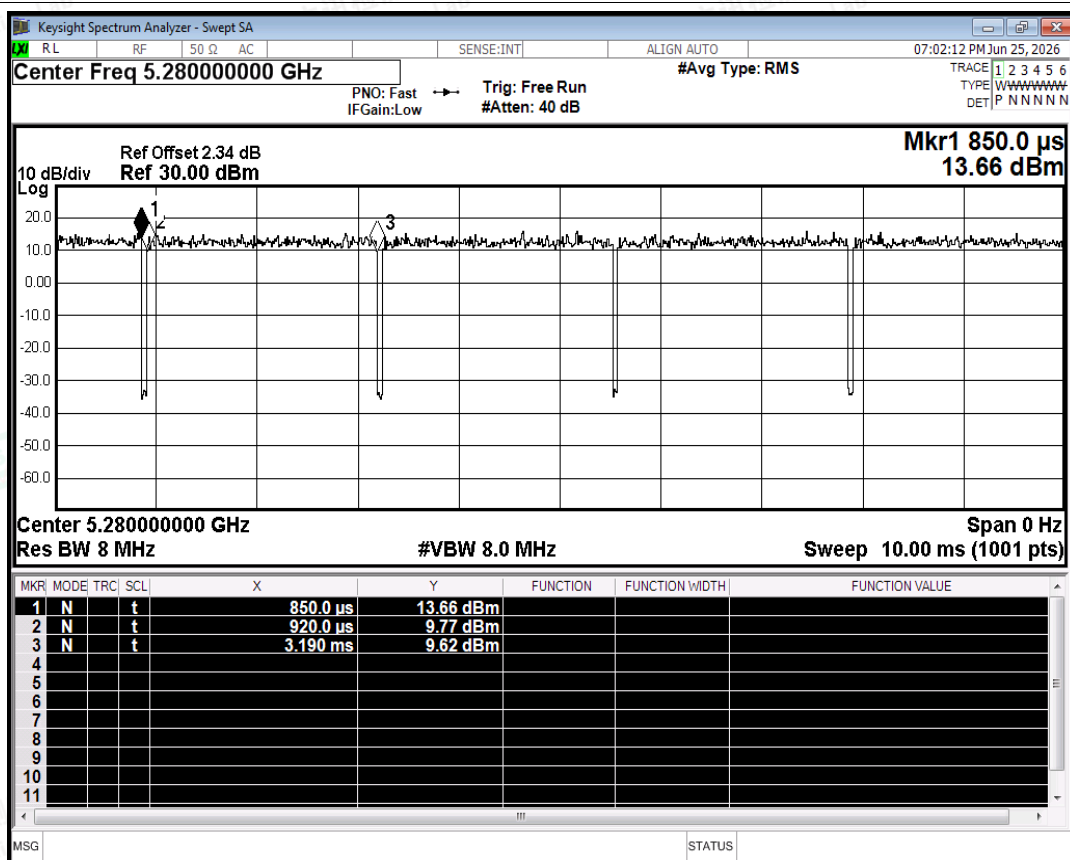

Duty Cycle NVNT ac20 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

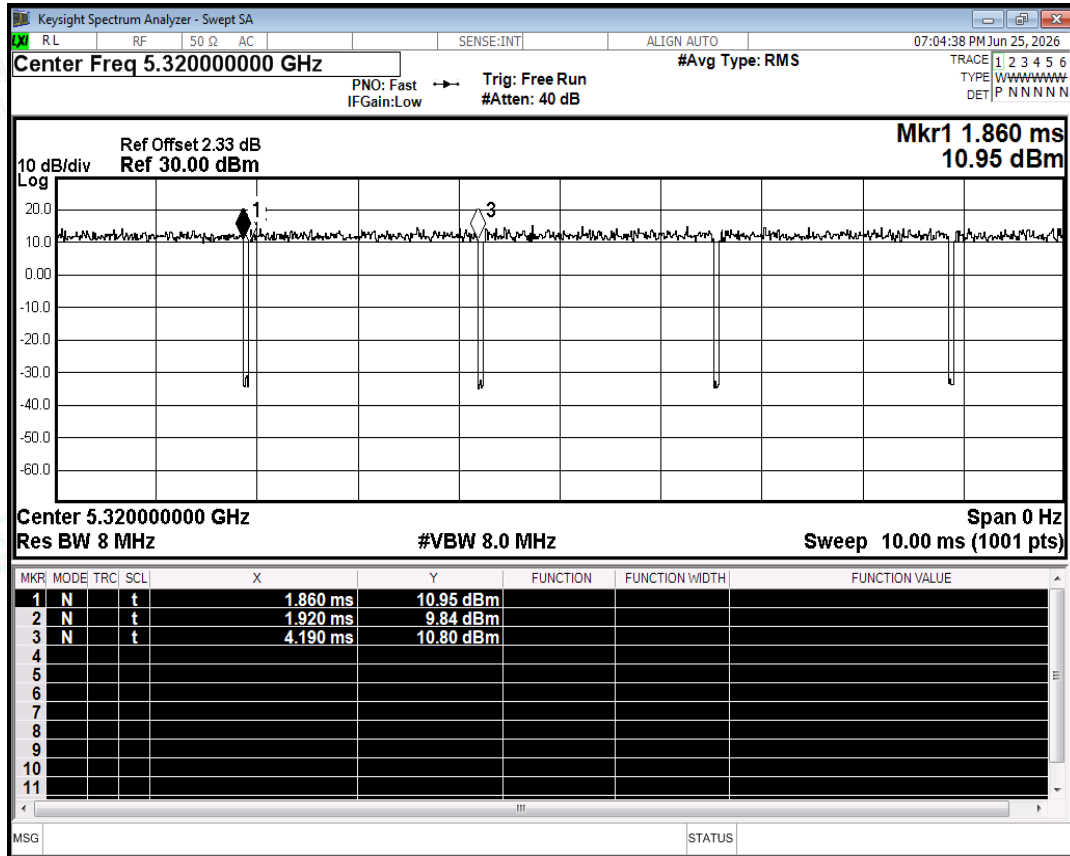

Duty Cycle NVNT ac20 5320MHz Ant1

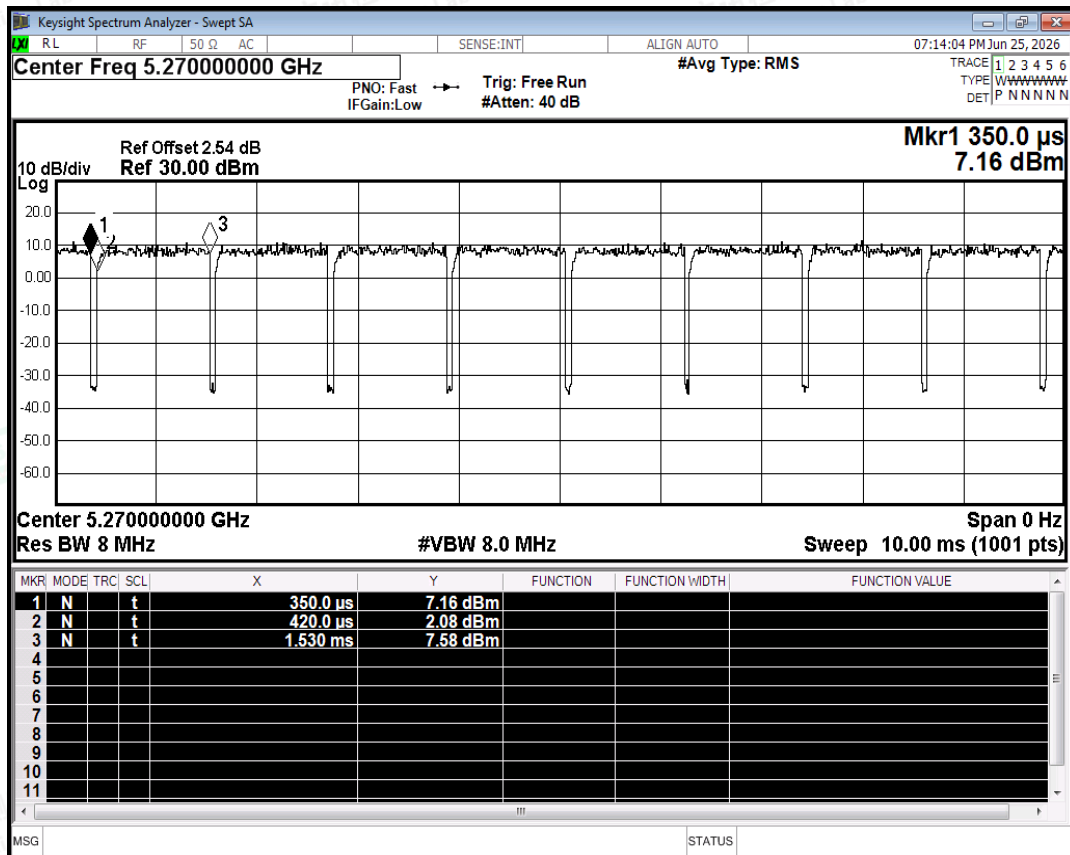

Duty Cycle NVNT ac40 5270MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

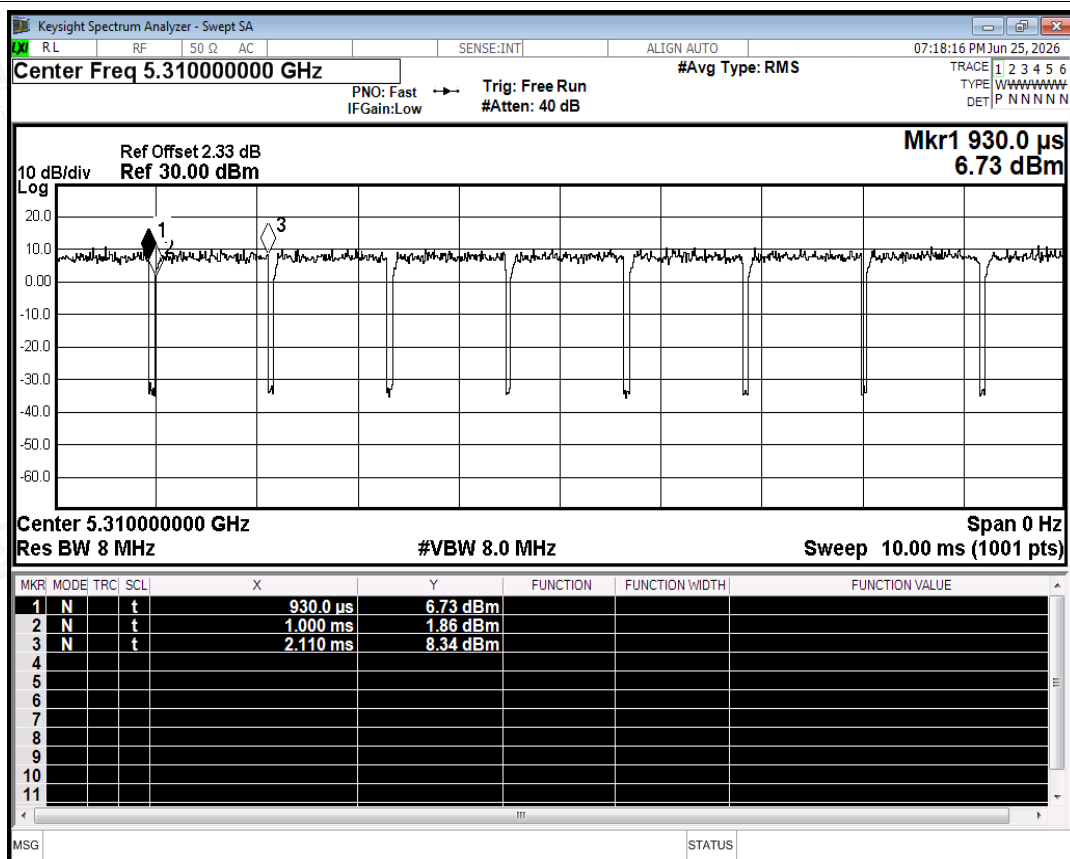

Duty Cycle NVNT ac40 5310MHz Ant1

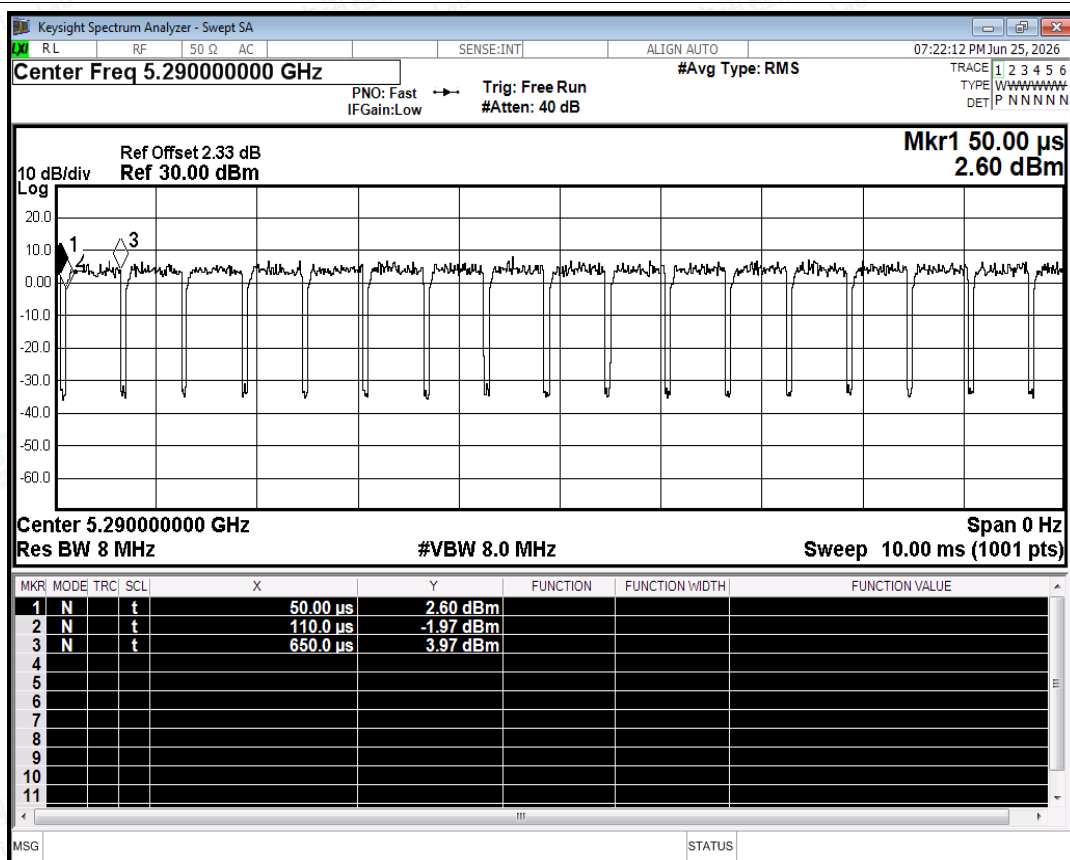

Duty Cycle NVNT ac80 5290MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



| Condition | Mode | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a    | 5260            | Ant2    | 97.46          | 0.11                   | 0.37      |
| NVNT      | a    | 5280            | Ant2    | 97.46          | 0.11                   | 0.37      |
| NVNT      | a    | 5320            | Ant2    | 97.46          | 0.11                   | 0.37      |
| NVNT      | n20  | 5260            | Ant2    | 97             | 0.13                   | 0.44      |
| NVNT      | n20  | 5280            | Ant2    | 97.42          | 0.11                   | 0.44      |
| NVNT      | n20  | 5320            | Ant2    | 97             | 0.13                   | 0.44      |
| NVNT      | n40  | 5270            | Ant2    | 94.87          | 0.23                   | 0.9       |
| NVNT      | n40  | 5310            | Ant2    | 94.87          | 0.23                   | 0.9       |
| NVNT      | ac20 | 5260            | Ant2    | 97.42          | 0.11                   | 0.44      |
| NVNT      | ac20 | 5280            | Ant2    | 97.42          | 0.11                   | 0.44      |
| NVNT      | ac20 | 5320            | Ant2    | 97.42          | 0.11                   | 0.44      |
| NVNT      | ac40 | 5270            | Ant2    | 94.87          | 0.23                   | 0.9       |
| NVNT      | ac40 | 5310            | Ant2    | 94.87          | 0.23                   | 0.9       |
| NVNT      | ac80 | 5290            | Ant2    | 88.33          | 0.54                   | 1.89      |




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

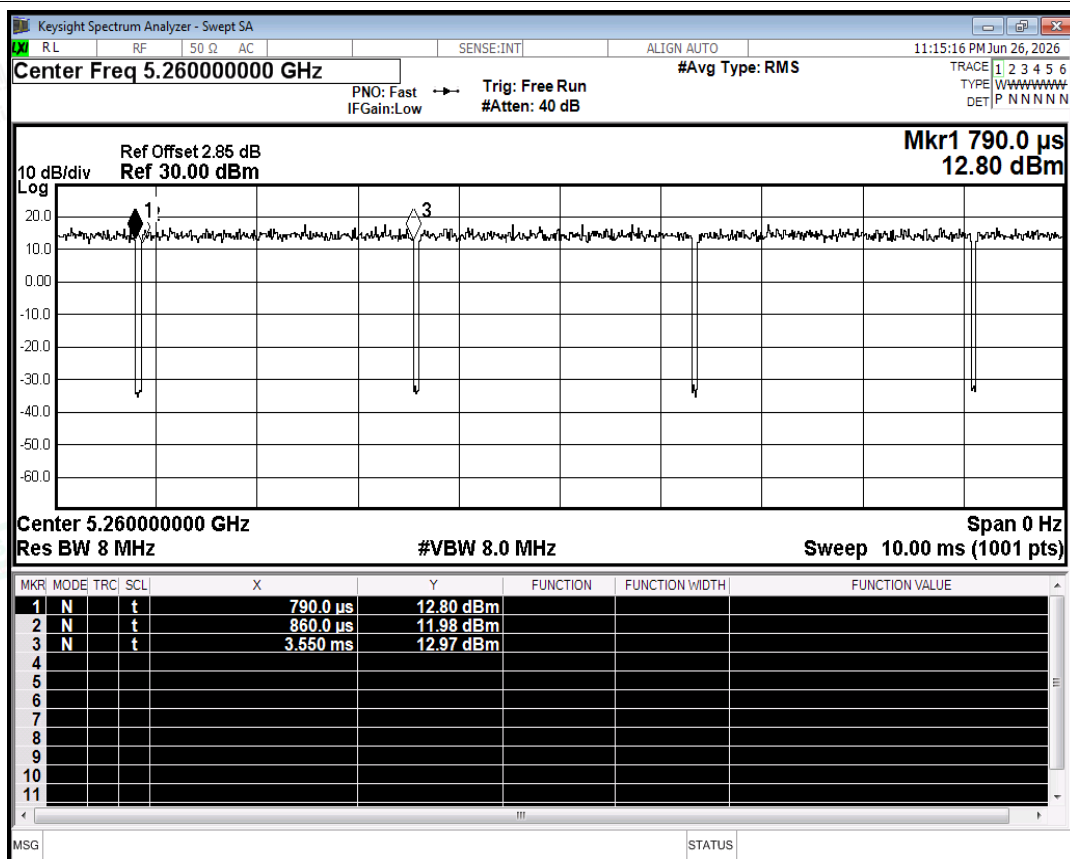

Duty Cycle NVNT a 5260MHz Ant2

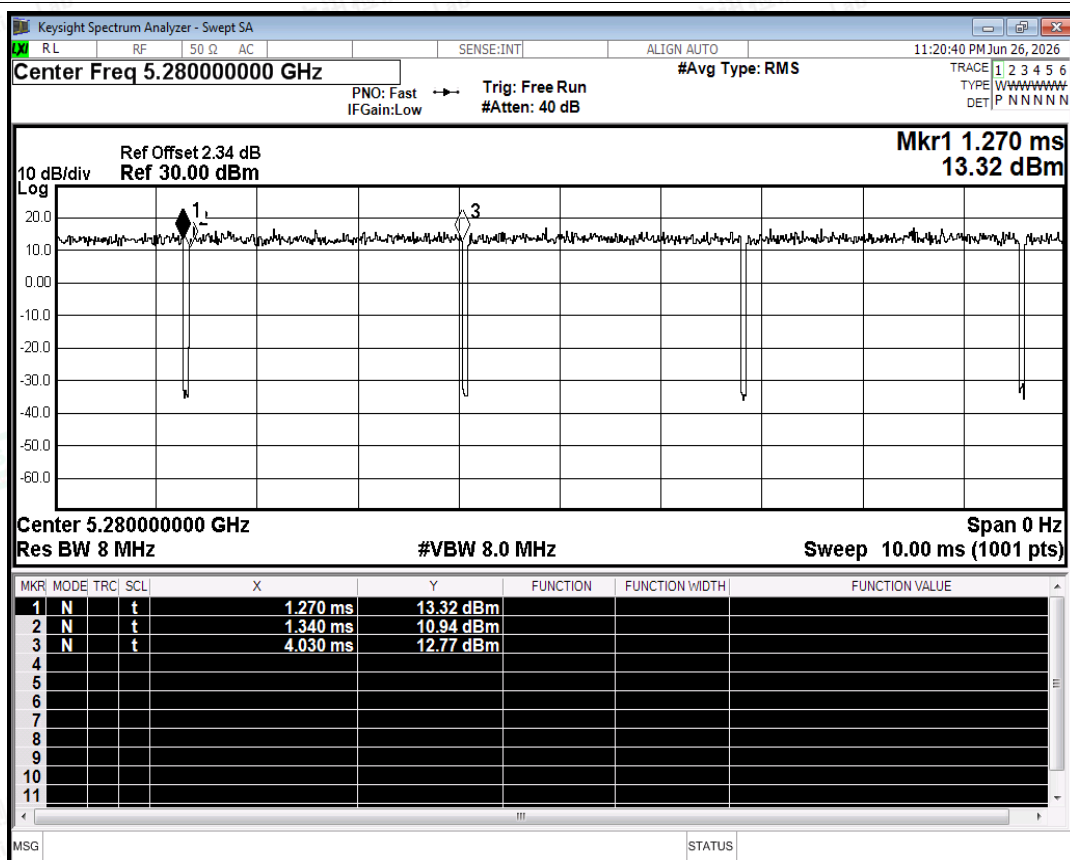

Duty Cycle NVNT a 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

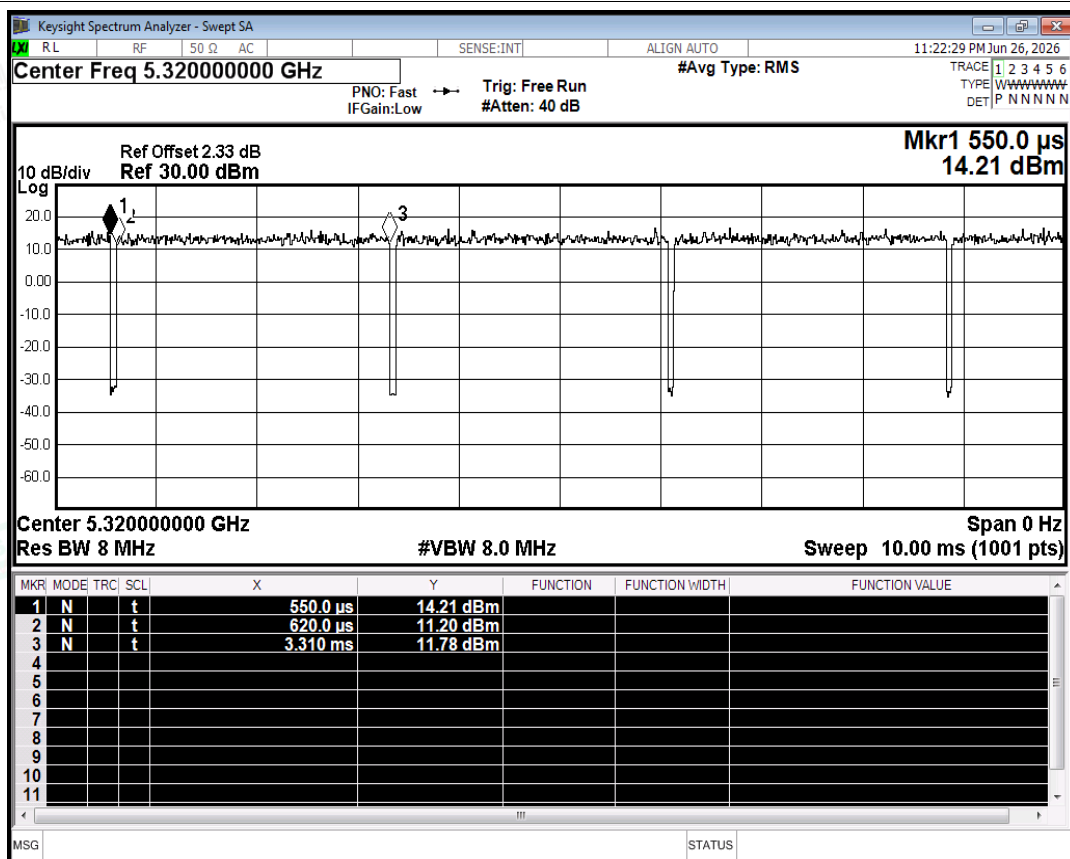

Duty Cycle NVNT a 5320MHz Ant2

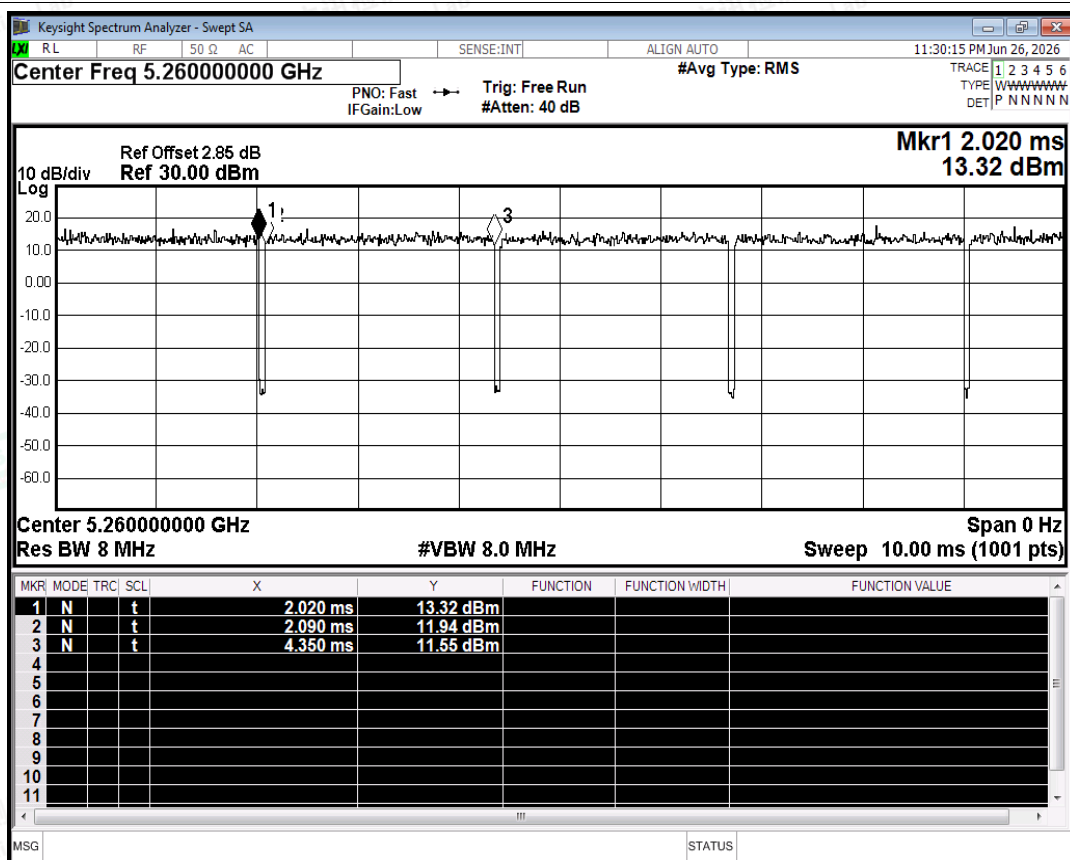

Duty Cycle NVNT n20 5260MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

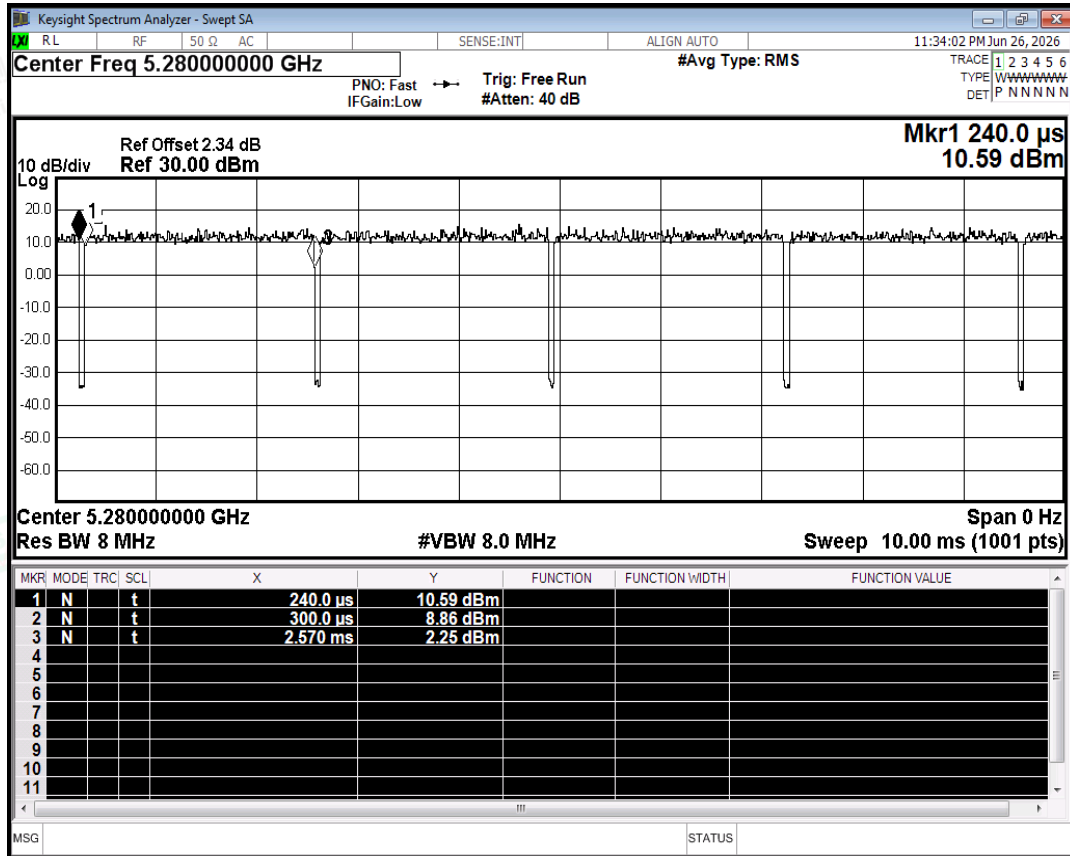

Duty Cycle NVNT n20 5280MHz Ant2

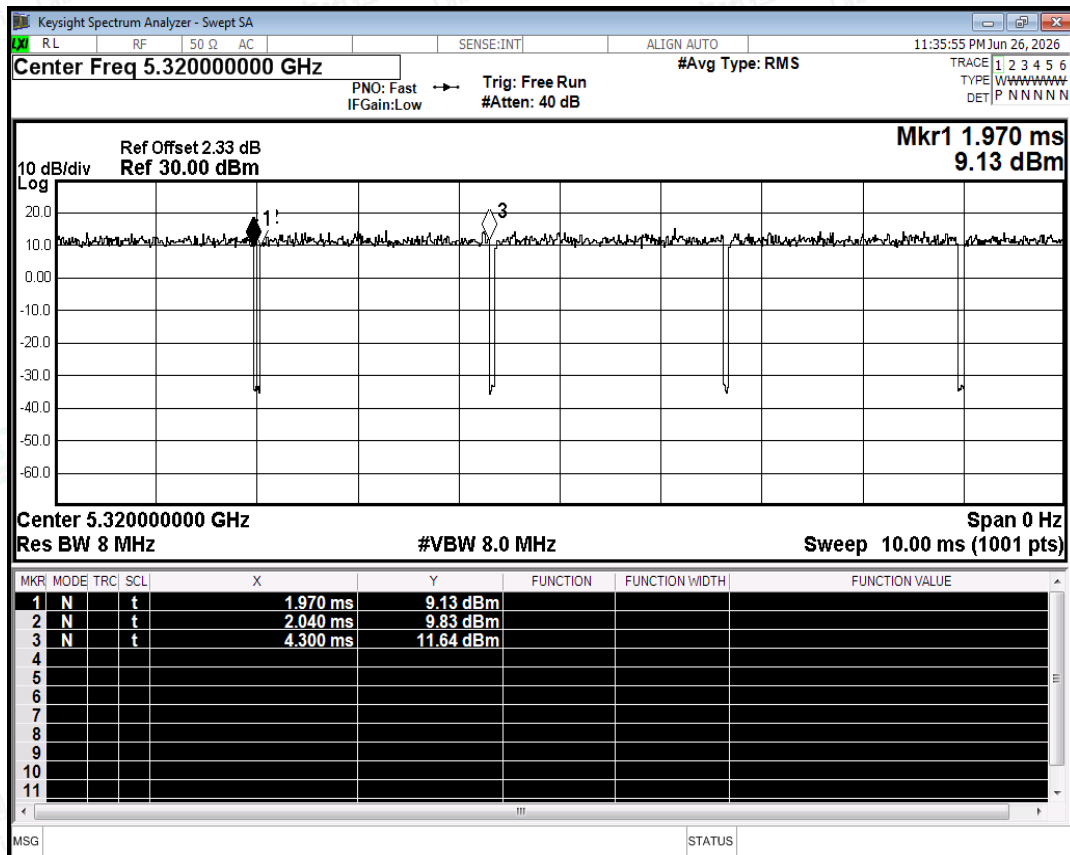

Duty Cycle NVNT n20 5320MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

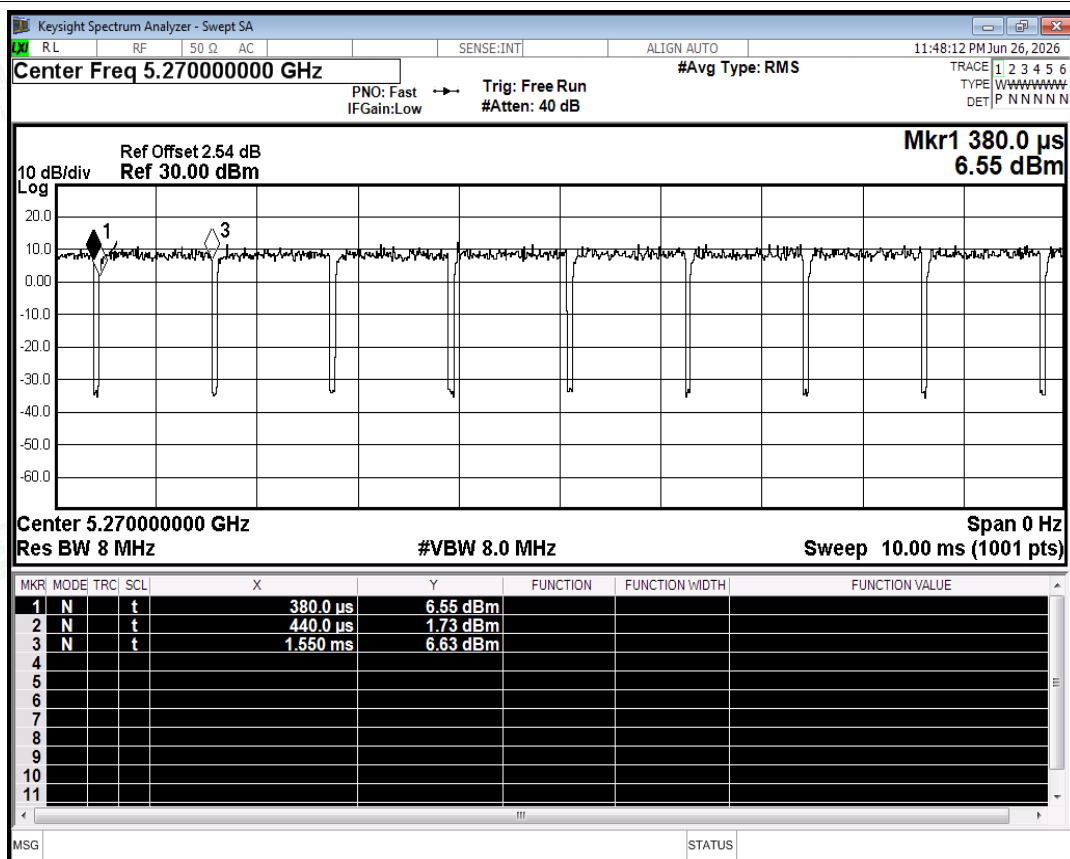

Duty Cycle NVNT n40 5270MHz Ant2

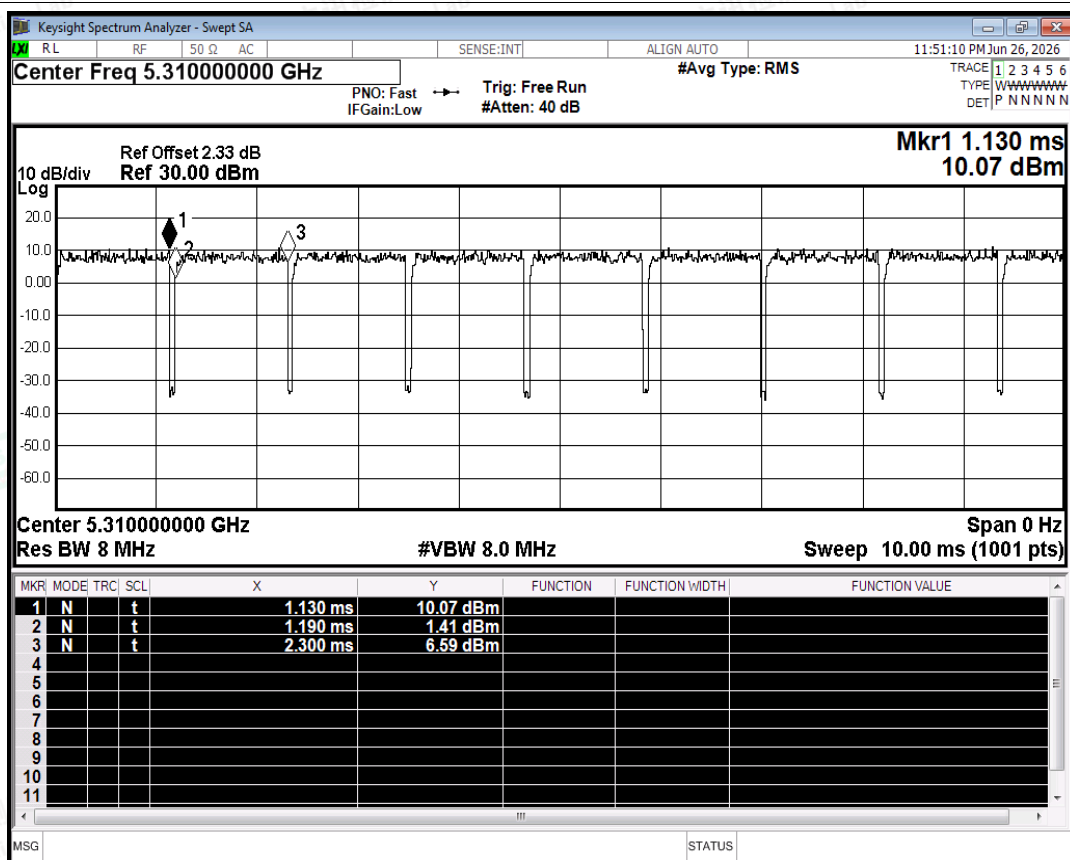

Duty Cycle NVNT n40 5310MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

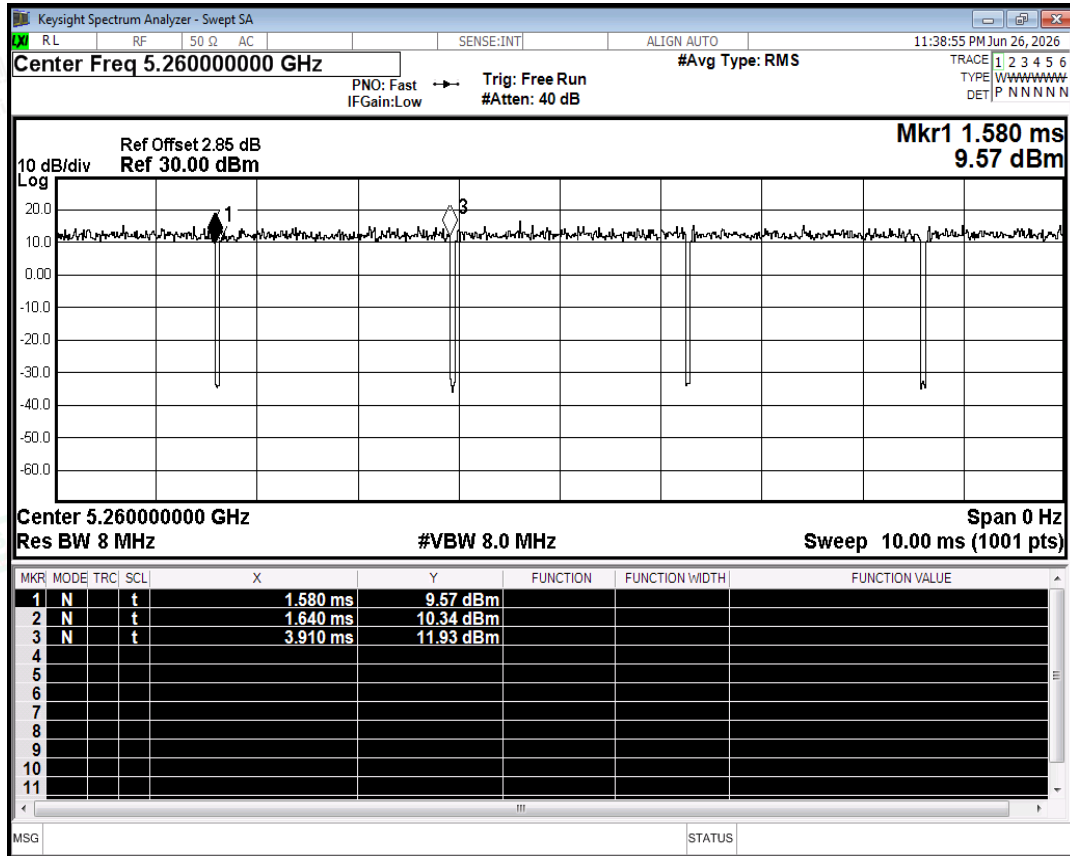

Duty Cycle NVNT ac20 5260MHz Ant2

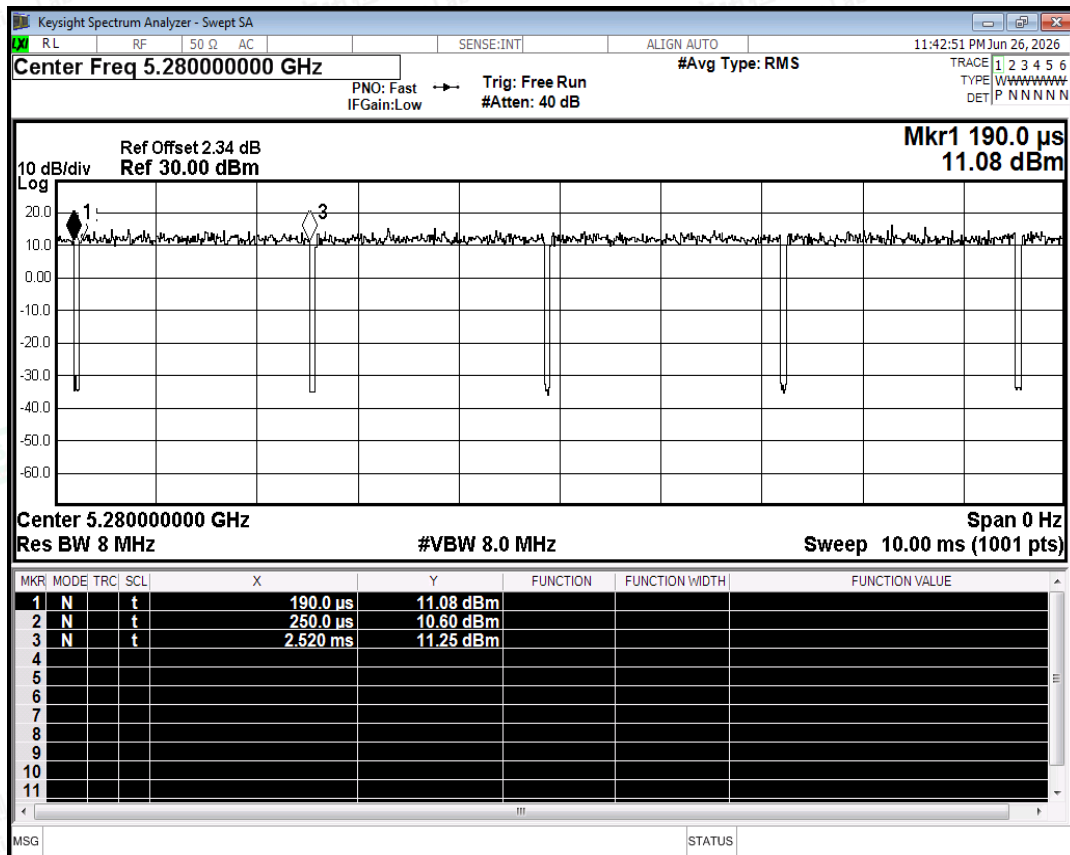

Duty Cycle NVNT ac20 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

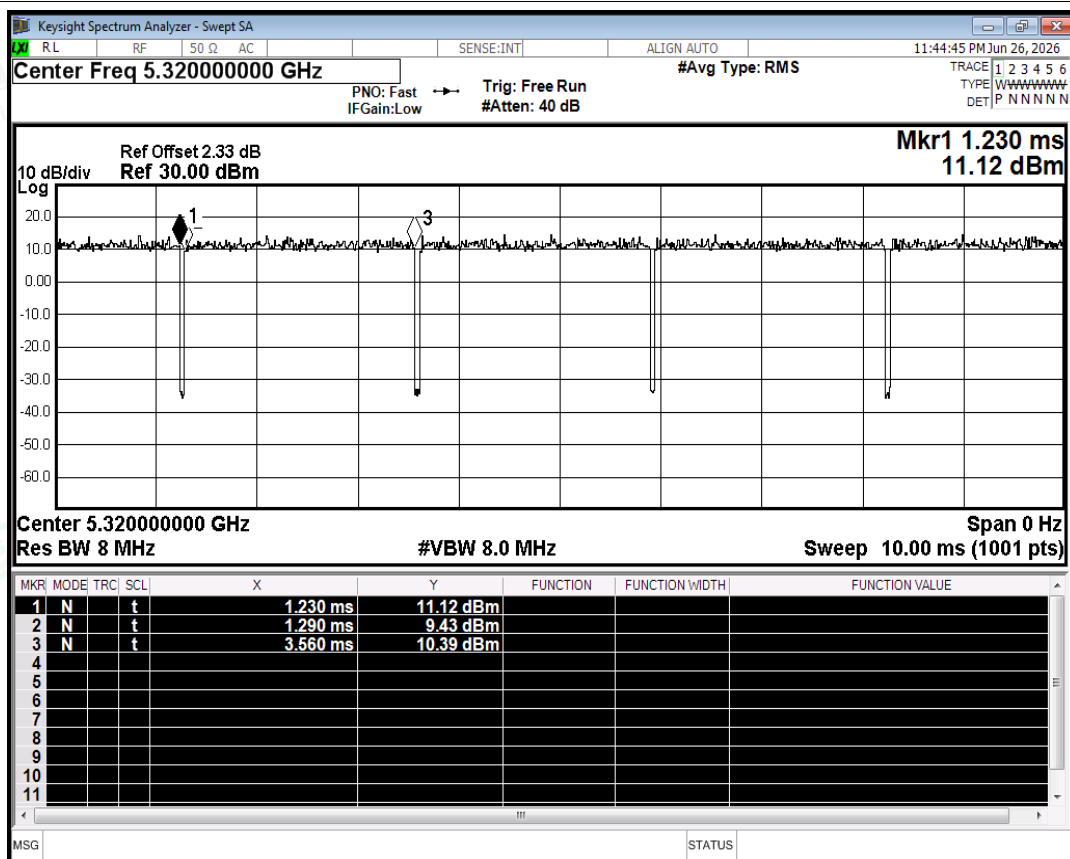

Duty Cycle NVNT ac20 5320MHz Ant2

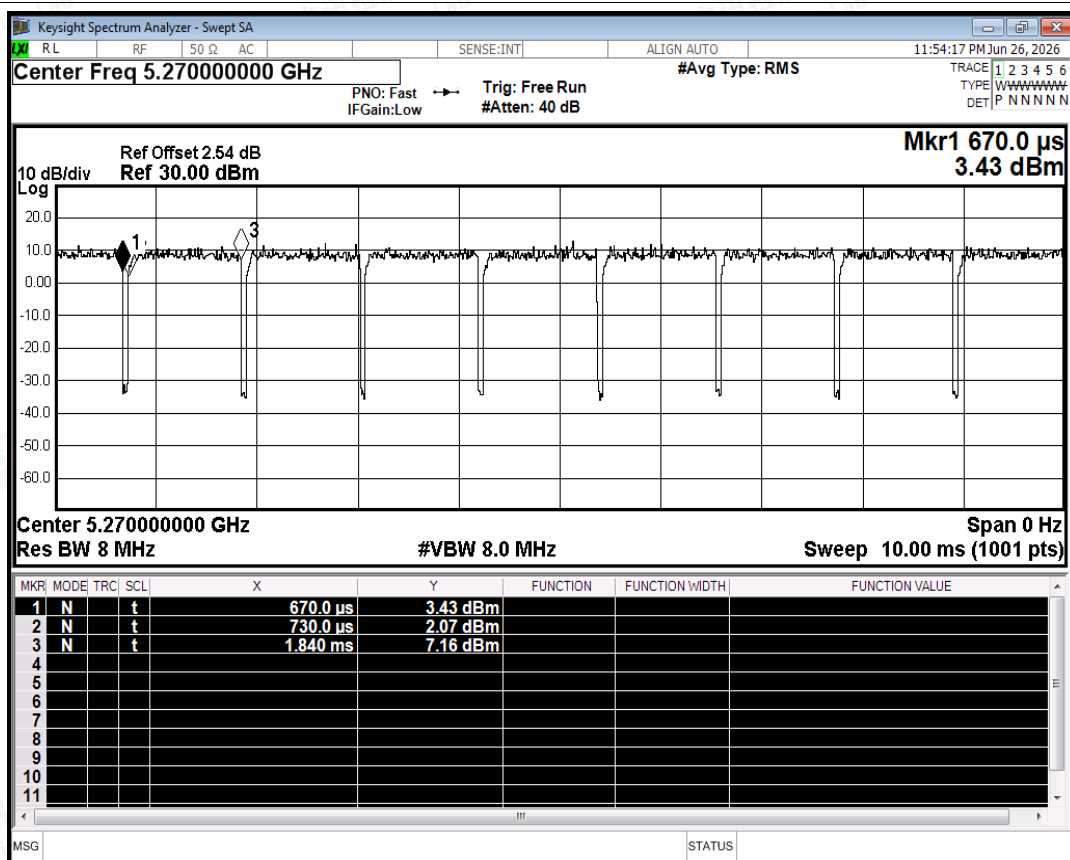

Duty Cycle NVNT ac40 5270MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

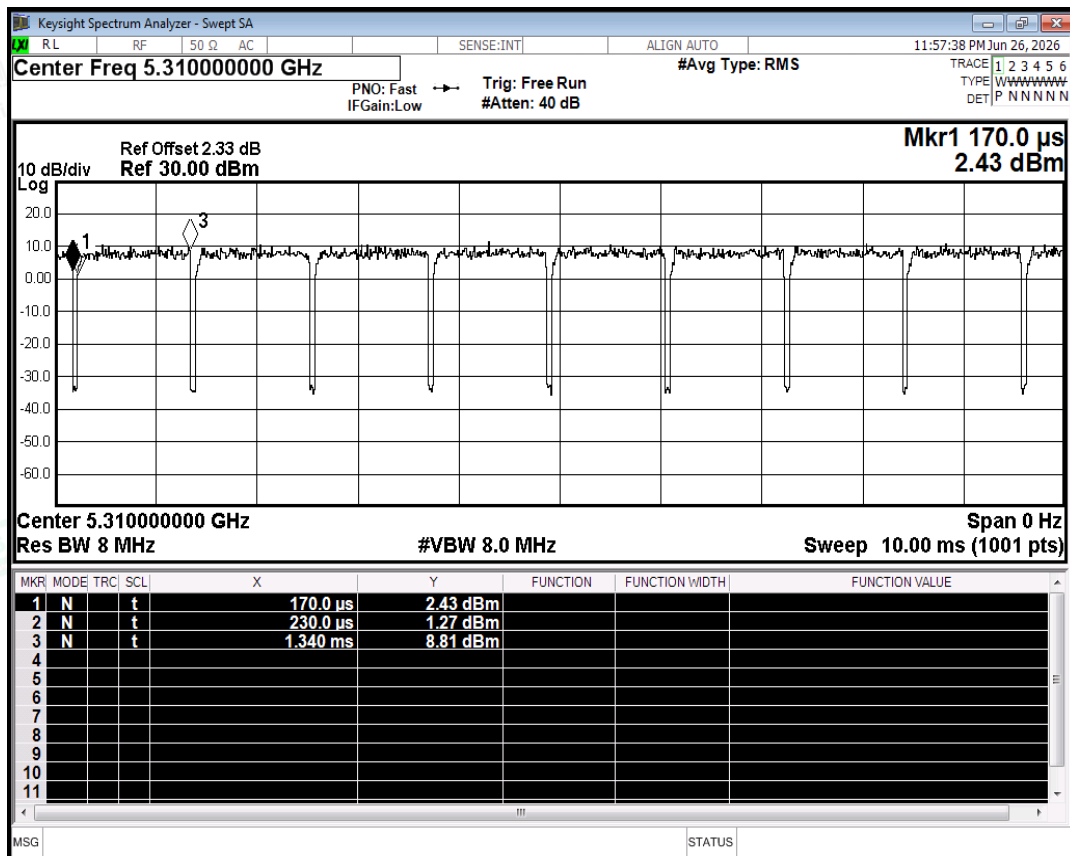

Duty Cycle NVNT ac40 5310MHz Ant2

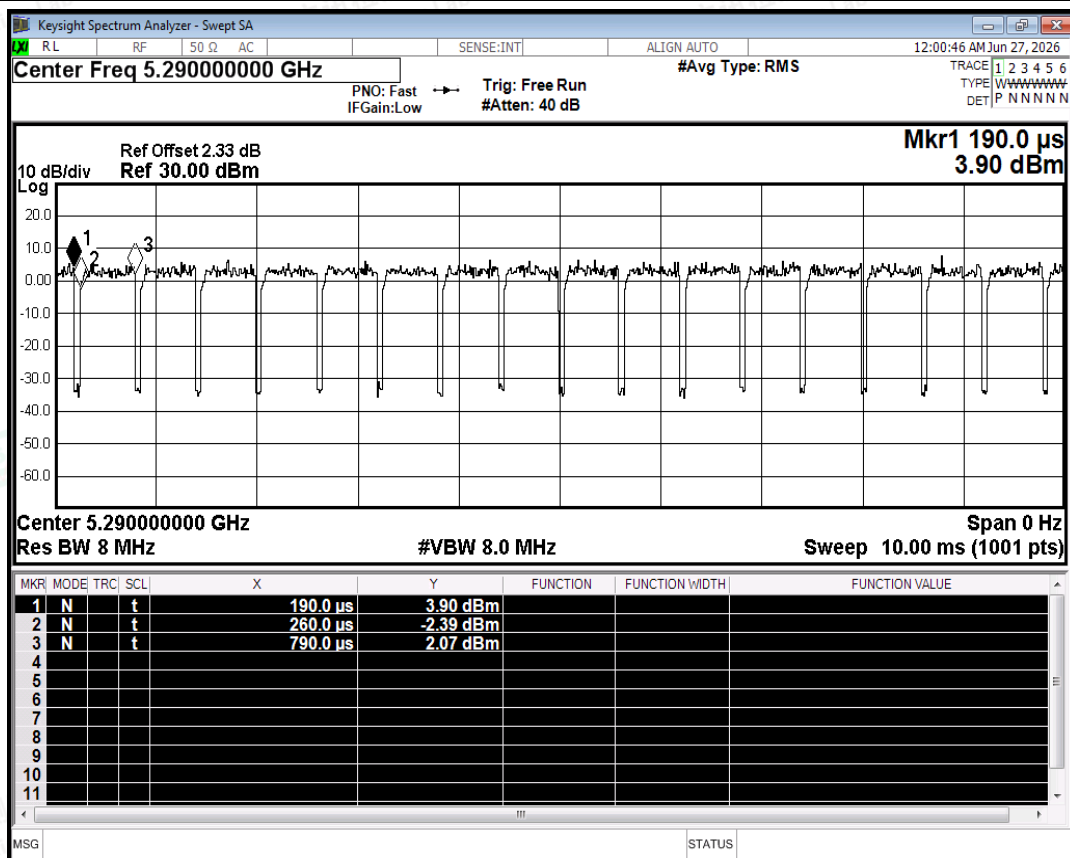

Duty Cycle NVNT ac80 5290MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity