




Band5-3MHz-QPSK-20415-1RB#0



Band5-3MHz-QPSK-20415-1RB#14

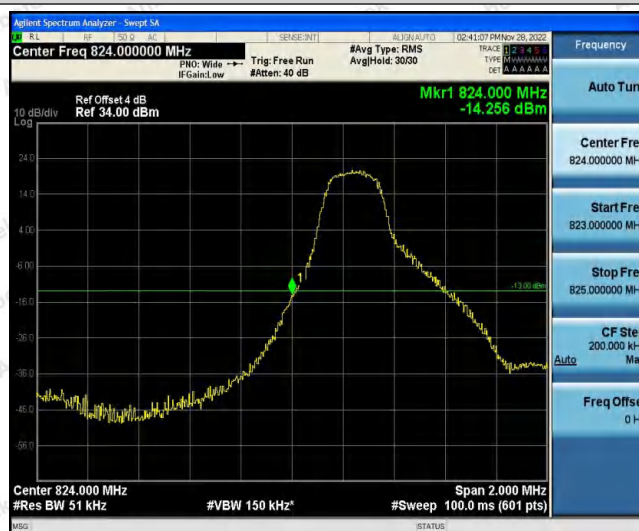

Band5-3MHz-QPSK-20415-15RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500


www.anbotek.com



Band5-3MHz-QPSK-20635-1RB#0



Band5-3MHz-QPSK-20635-1RB#14

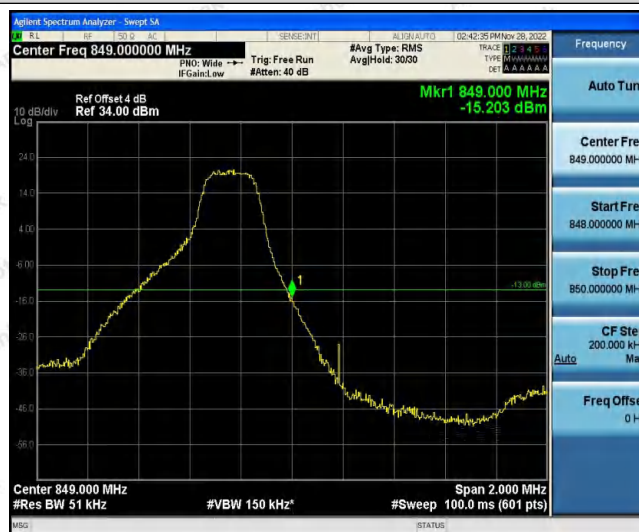

Band5-3MHz-QPSK-20635-15RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Band5-3MHz-16QAM-20415-1RB#0



Band5-3MHz-16QAM-20415-1RB#14



Band5-3MHz-16QAM-20415-15RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

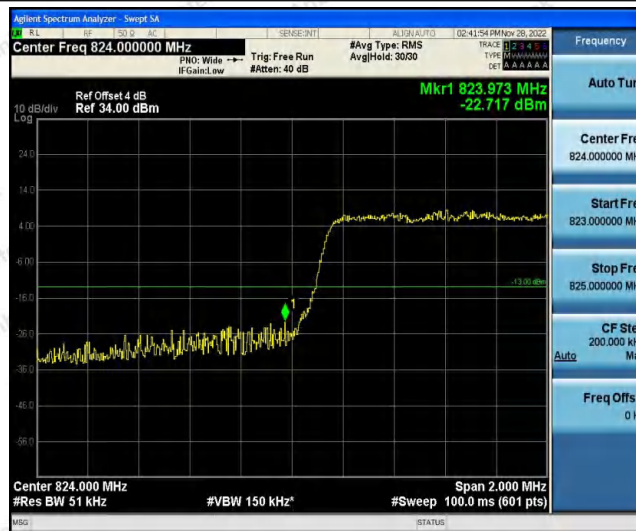

Band5-3MHz-16QAM-20635-1RB#0

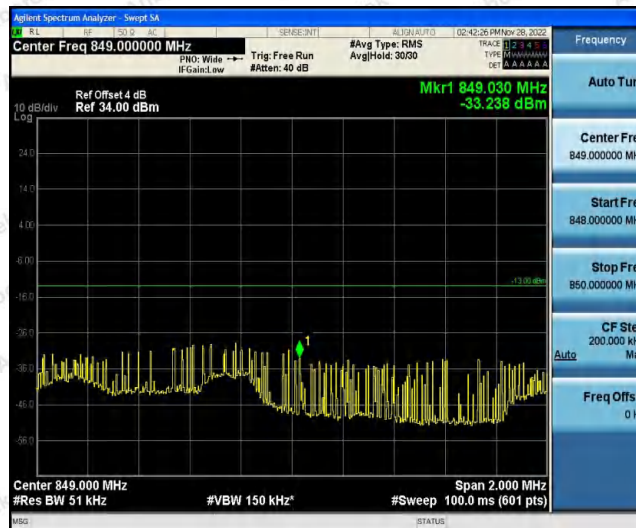

Band5-3MHz-16QAM-20635-1RB#14

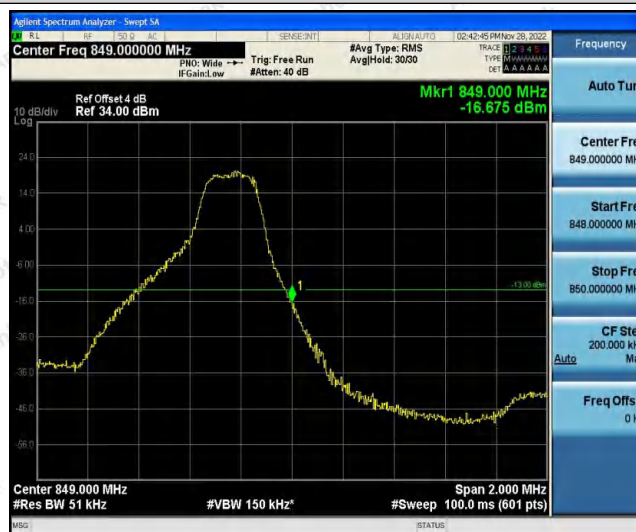

Band5-3MHz-16QAM-20635-15RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Band5-5MHz-QPSK-20425-1RB#0



Band5-5MHz-QPSK-20425-1RB#24



Band5-5MHz-QPSK-20425-25RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Band5-5MHz-QPSK-20625-1RB#0



Band5-5MHz-QPSK-20625-1RB#24



Band5-5MHz-QPSK-20625-25RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Band5-5MHz-16QAM-20425-1RB#0



Band5-5MHz-16QAM-20425-1RB#24



Band5-5MHz-16QAM-20425-25RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Band5-5MHz-16QAM-20625-1RB#0



Band5-5MHz-16QAM-20625-1RB#24



Band5-5MHz-16QAM-20625-25RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Band5-10MHz-QPSK-20450-1RB#0



Band5-10MHz-QPSK-20450-1RB#49



Band5-10MHz-QPSK-20450-50RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Band5-10MHz-QPSK-20600-1RB#0



Band5-10MHz-QPSK-20600-1RB#49



Band5-10MHz-QPSK-20600-50RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Band5-10MHz-16QAM-20450-1RB#0



Band5-10MHz-16QAM-20450-1RB#49



Band5-10MHz-16QAM-20450-50RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Band5-10MHz-16QAM-20600-1RB#0



Band5-10MHz-16QAM-20600-1RB#49



Band5-10MHz-16QAM-20600-50RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline

400-003-0500

www.anbotek.com

Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band5	1.4MHz	QPSK	20407	1RB#0	Range1:30~1000MHz	-51.36	PASS
Band5	1.4MHz	QPSK	20407	1RB#0	Range2:1000~10000MHz	-21.29	PASS
Band5	1.4MHz	QPSK	20525	1RB#0	Range1:30~1000MHz	-51.16	PASS
Band5	1.4MHz	QPSK	20525	1RB#0	Range2:1000~10000MHz	-20.15	PASS
Band5	1.4MHz	QPSK	20643	1RB#0	Range1:30~1000MHz	-51.13	PASS
Band5	1.4MHz	QPSK	20643	1RB#0	Range2:1000~10000MHz	-22.42	PASS
Band5	1.4MHz	16QAM	20407	1RB#0	Range1:30~1000MHz	-51.44	PASS
Band5	1.4MHz	16QAM	20407	1RB#0	Range2:1000~10000MHz	-23.79	PASS
Band5	1.4MHz	16QAM	20525	1RB#0	Range1:30~1000MHz	-51.33	PASS
Band5	1.4MHz	16QAM	20525	1RB#0	Range2:1000~10000MHz	-17.87	PASS
Band5	1.4MHz	16QAM	20643	1RB#0	Range1:30~1000MHz	-50.43	PASS
Band5	1.4MHz	16QAM	20643	1RB#0	Range2:1000~10000MHz	-22.47	PASS
Band5	3MHz	QPSK	20415	1RB#0	Range1:30~1000MHz	-51.02	PASS
Band5	3MHz	QPSK	20415	1RB#0	Range2:1000~10000MHz	-17.81	PASS
Band5	3MHz	QPSK	20525	1RB#0	Range1:30~1000MHz	-50.88	PASS
Band5	3MHz	QPSK	20525	1RB#0	Range2:1000~10000MHz	-19.11	PASS
Band5	3MHz	QPSK	20635	1RB#0	Range1:30~1000MHz	-50.6	PASS
Band5	3MHz	QPSK	20635	1RB#0	Range2:1000~10000MHz	-21.85	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

Band5	3MHz	16QAM	20415	1RB#0	Range1:30~1000MHz	-50.92	PASS
Band5	3MHz	16QAM	20415	1RB#0	Range2:1000~10000MHz	-24.18	PASS
Band5	3MHz	16QAM	20525	1RB#0	Range1:30~1000MHz	-51.25	PASS
Band5	3MHz	16QAM	20525	1RB#0	Range2:1000~10000MHz	-21.98	PASS
Band5	3MHz	16QAM	20635	1RB#0	Range1:30~1000MHz	-51.37	PASS
Band5	3MHz	16QAM	20635	1RB#0	Range2:1000~10000MHz	-23.09	PASS
Band5	5MHz	QPSK	20425	1RB#0	Range1:30~1000MHz	-51.41	PASS
Band5	5MHz	QPSK	20425	1RB#0	Range2:1000~10000MHz	-22.3	PASS
Band5	5MHz	QPSK	20525	1RB#0	Range1:30~1000MHz	-50.97	PASS
Band5	5MHz	QPSK	20525	1RB#0	Range2:1000~10000MHz	-22.27	PASS
Band5	5MHz	QPSK	20625	1RB#0	Range1:30~1000MHz	-51.52	PASS
Band5	5MHz	QPSK	20625	1RB#0	Range2:1000~10000MHz	-22.16	PASS
Band5	5MHz	16QAM	20425	1RB#0	Range1:30~1000MHz	-50.79	PASS
Band5	5MHz	16QAM	20425	1RB#0	Range2:1000~10000MHz	-19.17	PASS
Band5	5MHz	16QAM	20525	1RB#0	Range1:30~1000MHz	-51.72	PASS
Band5	5MHz	16QAM	20525	1RB#0	Range2:1000~10000MHz	-25.18	PASS
Band5	5MHz	16QAM	20625	1RB#0	Range1:30~1000MHz	-51.19	PASS
Band5	5MHz	16QAM	20625	1RB#0	Range2:1000~10000MHz	-26.13	PASS
Band5	10MHz	QPSK	20450	1RB#0	Range1:30~1000MHz	-51.68	PASS
Band5	10MHz	QPSK	20450	1RB#0	Range2:1000~10000MHz	-22.95	PASS
Band5	10MHz	QPSK	20525	1RB#0	Range1:30~1000MHz	-50.78	PASS
Band5	10MHz	QPSK	20525	1RB#0	Range2:1000~10000MHz	-20.49	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

Band5	10MHz	QPSK	20600	1RB#0	Range1:30~1000MHz	-49.89	PASS
Band5	10MHz	QPSK	20600	1RB#0	Range2:1000~10000MHz	-25.63	PASS
Band5	10MHz	16QAM	20450	1RB#0	Range1:30~1000MHz	-51.81	PASS
Band5	10MHz	16QAM	20450	1RB#0	Range2:1000~10000MHz	-21.14	PASS
Band5	10MHz	16QAM	20525	1RB#0	Range1:30~1000MHz	-51.27	PASS
Band5	10MHz	16QAM	20525	1RB#0	Range2:1000~10000MHz	-22.12	PASS
Band5	10MHz	16QAM	20600	1RB#0	Range1:30~1000MHz	-51.26	PASS
Band5	10MHz	16QAM	20600	1RB#0	Range2:1000~10000MHz	-19.21	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com




Hotline
400-003-0500
www.anbotech.com

Test Graphs


Band5-1.4MHz-QPSK-20407-1RB#0-Range1:30~1000MHz

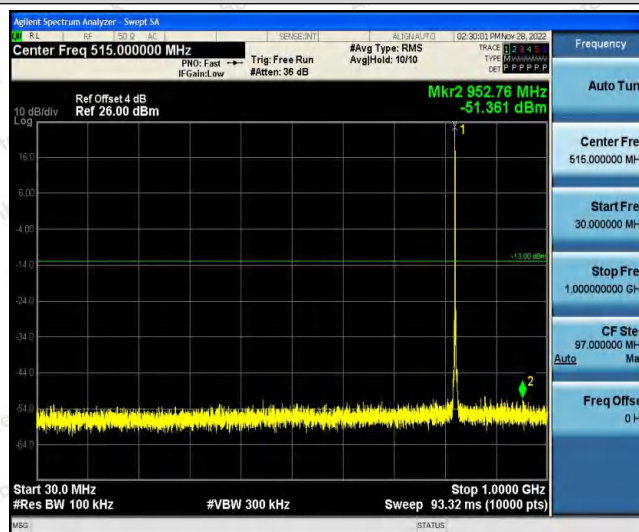

Band5-1.4MHz-QPSK-20407-1RB#0-Range2:1000~10000MHz

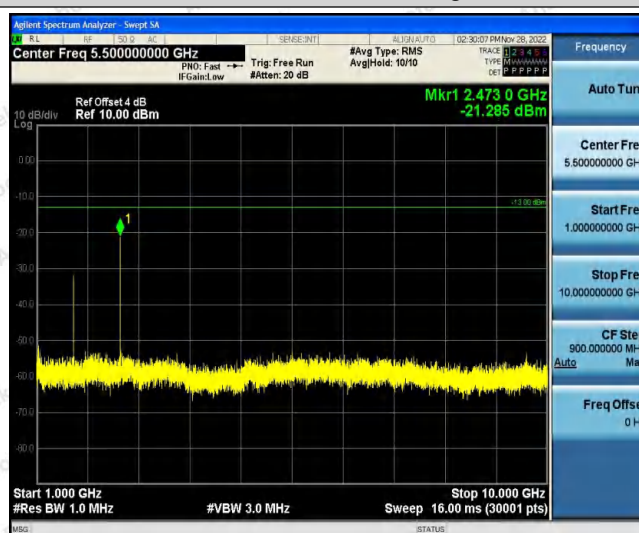

Band5-1.4MHz-QPSK-20525-1RB#0-Range1:30~1000MHz

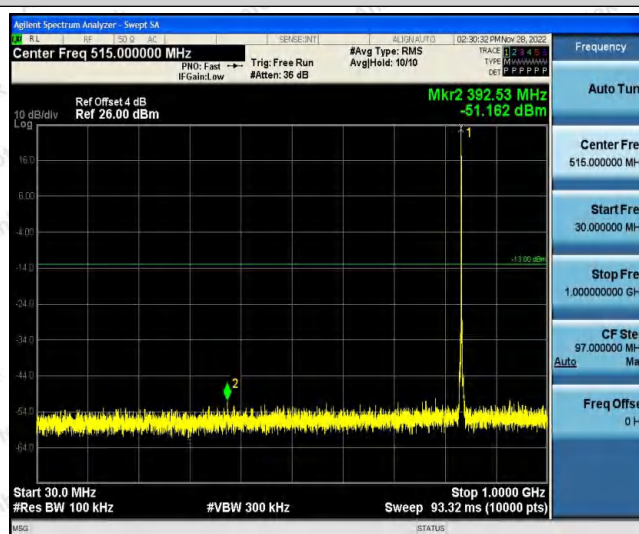

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline


400-003-0500

www.anbotek.com


Band5-1.4MHz-QPSK-20525-1RB#0-Range2:1000~10000MHz

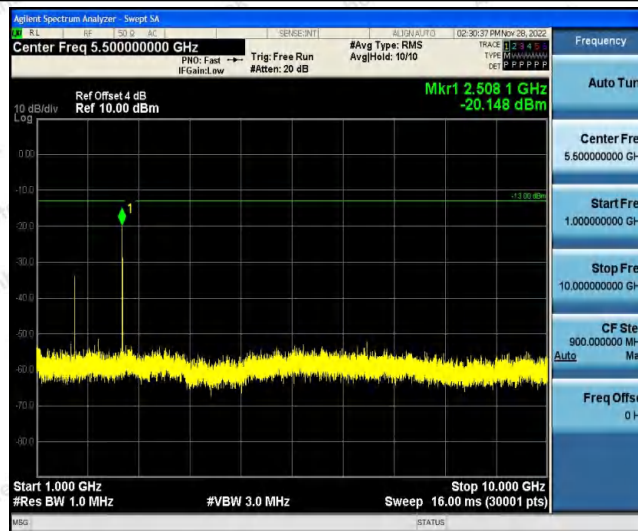

Band5-1.4MHz-QPSK-20643-1RB#0-Range1:30~1000MHz

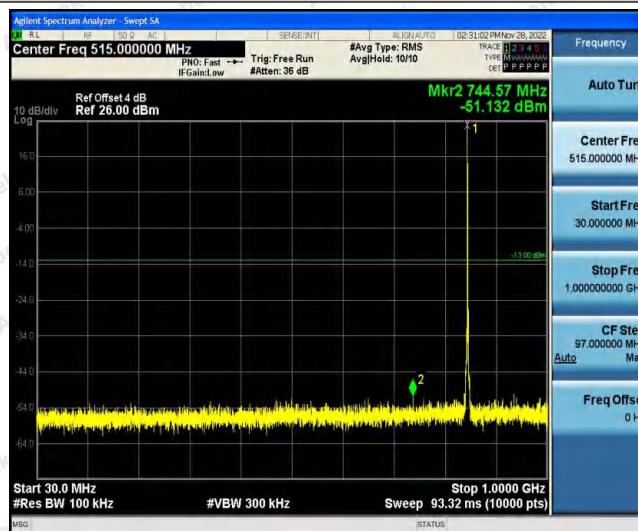

Band5-1.4MHz-QPSK-20643-1RB#0-Range2:1000~10000MHz

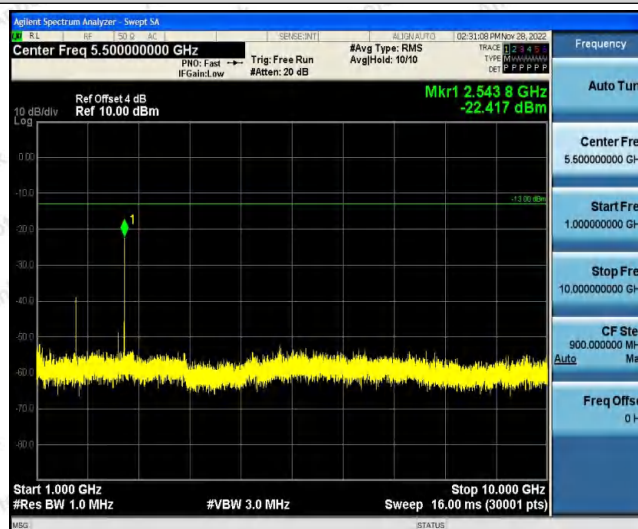

Band5-1.4MHz-16QAM-20407-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

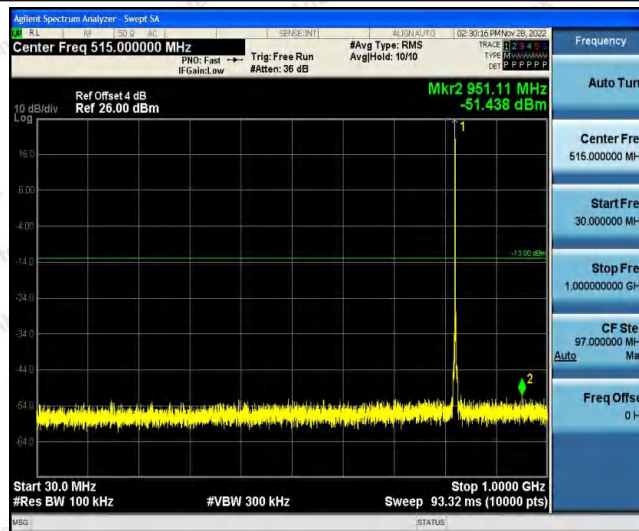

Band5-1.4MHz-16QAM-20407-1RB#0-Range2:1000~10000MHz

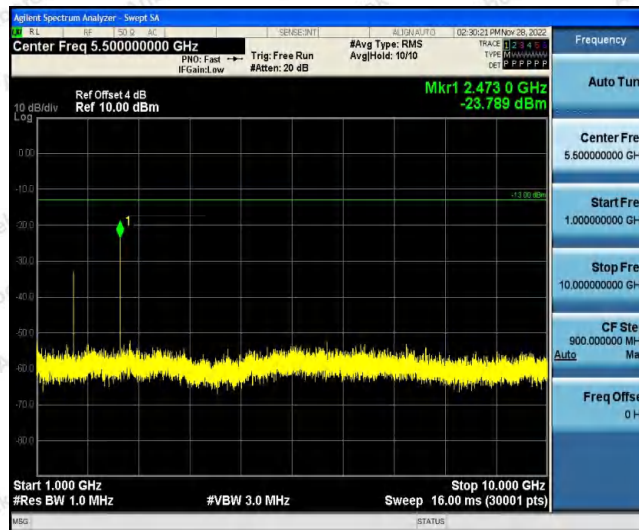

Band5-1.4MHz-16QAM-20525-1RB#0-Range1:30~1000MHz

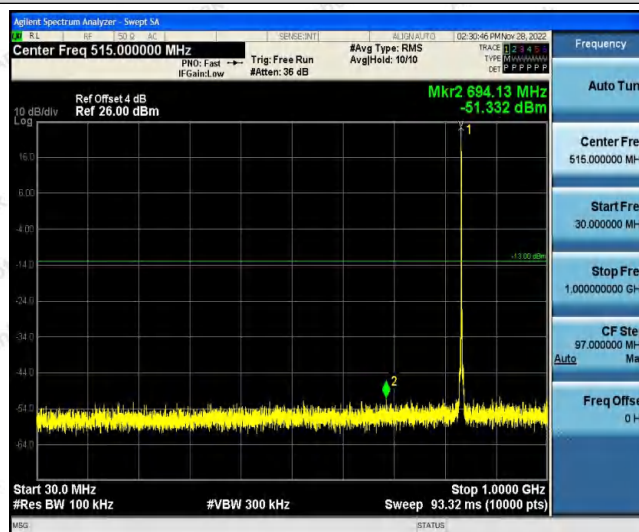

Band5-1.4MHz-16QAM-20525-1RB#0-Range2:1000~10000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

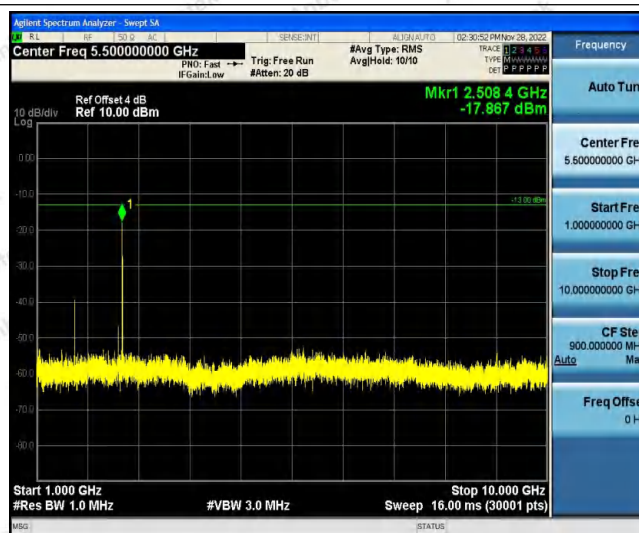

Band5-1.4MHz-16QAM-20643-1RB#0-Range1:30~1000MHz

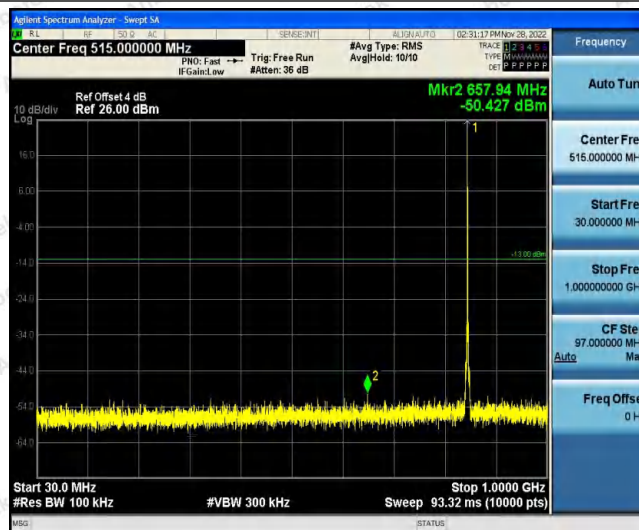

Band5-1.4MHz-16QAM-20643-1RB#0-Range2:1000~10000MHz

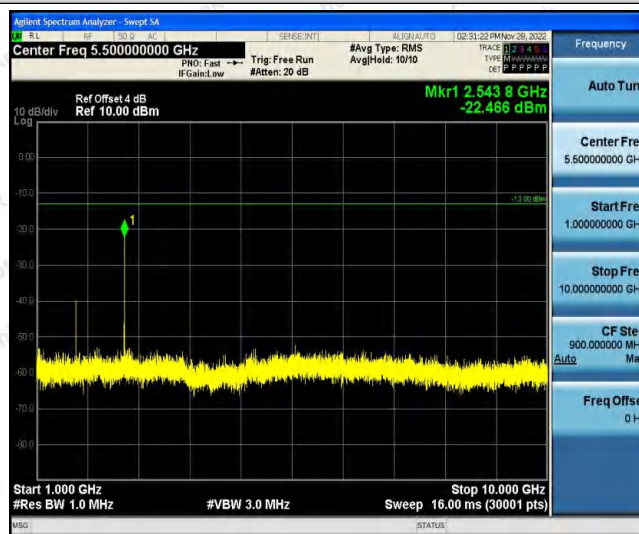

Band5-3MHz-QPSK-20415-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

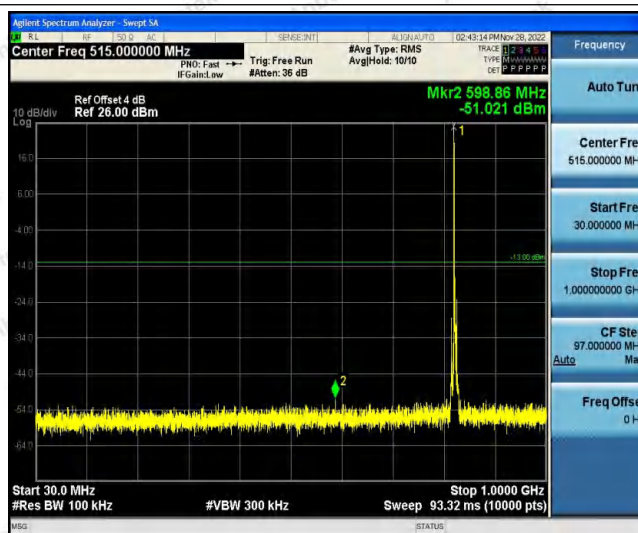

Band5-3MHz-QPSK-20415-1RB#0-Range2:1000~10000MHz

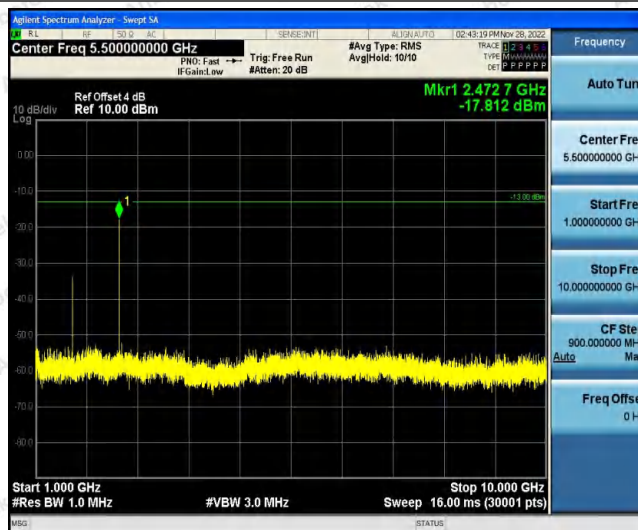

Band5-3MHz-QPSK-20525-1RB#0-Range1:30~1000MHz

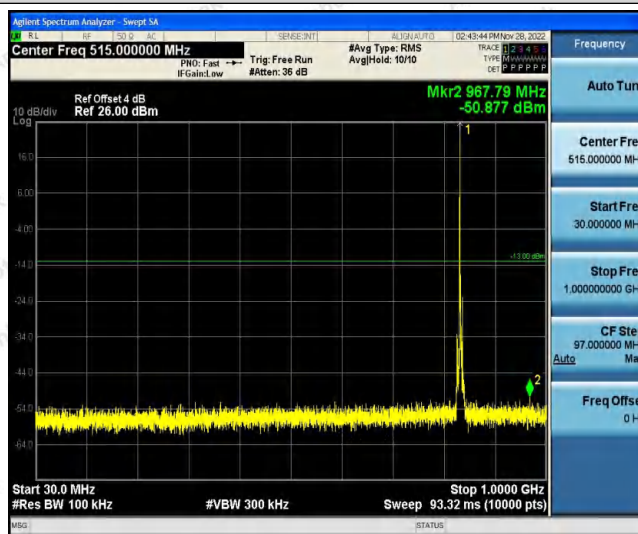

Band5-3MHz-QPSK-20525-1RB#0-Range2:1000~10000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

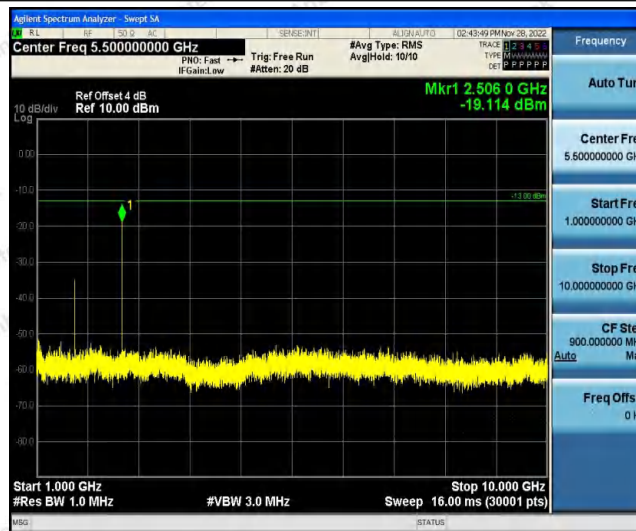

Band5-3MHz-QPSK-20635-1RB#0-Range1:30~1000MHz

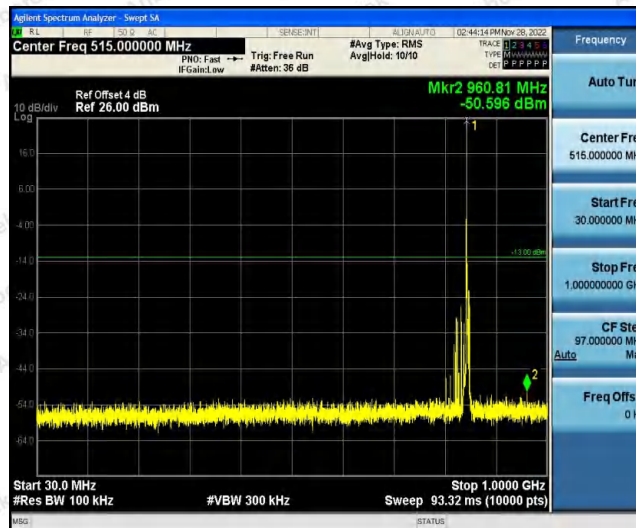

Band5-3MHz-QPSK-20635-1RB#0-Range2:1000~10000MHz

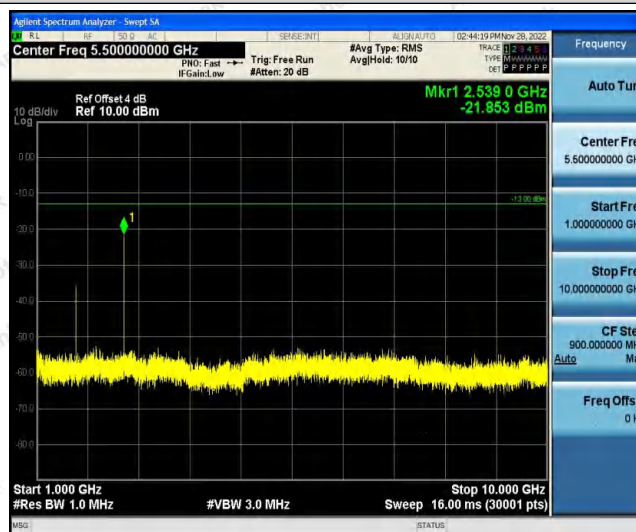

Band5-3MHz-16QAM-20415-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

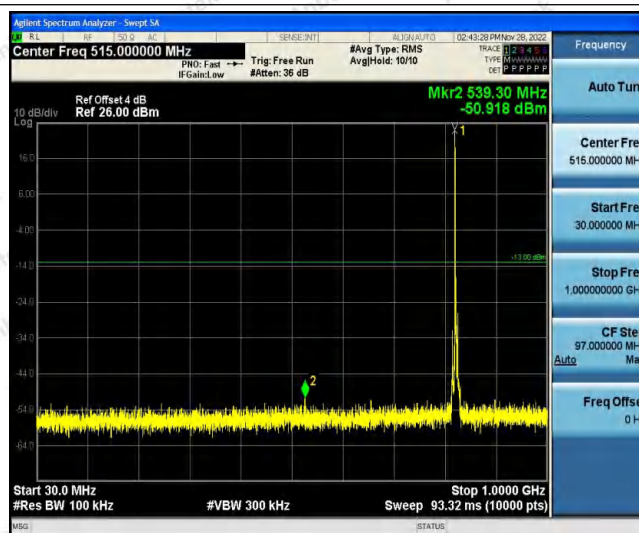

Band5-3MHz-16QAM-20415-1RB#0-Range2:1000~10000MHz

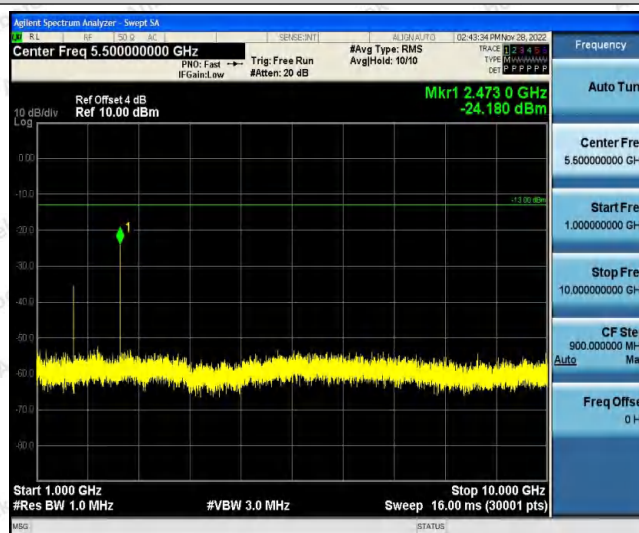

Band5-3MHz-16QAM-20525-1RB#0-Range1:30~1000MHz

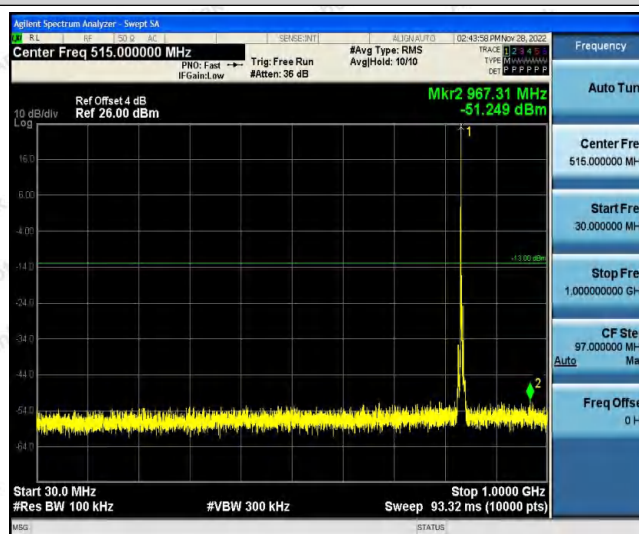

Band5-3MHz-16QAM-20525-1RB#0-Range2:1000~10000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

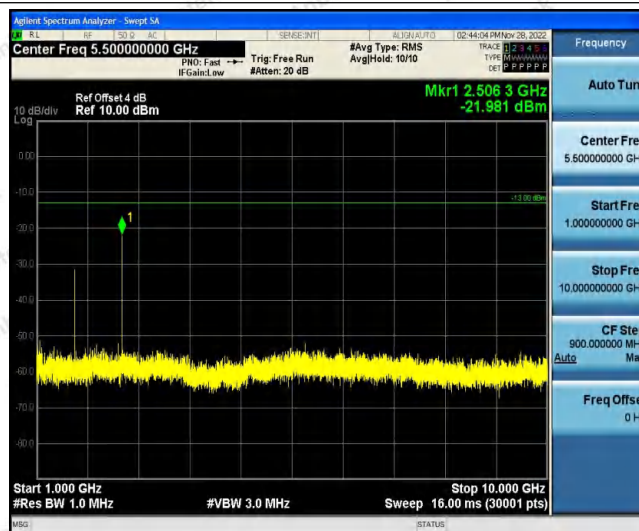

Band5-3MHz-16QAM-20635-1RB#0-Range1:30~1000MHz

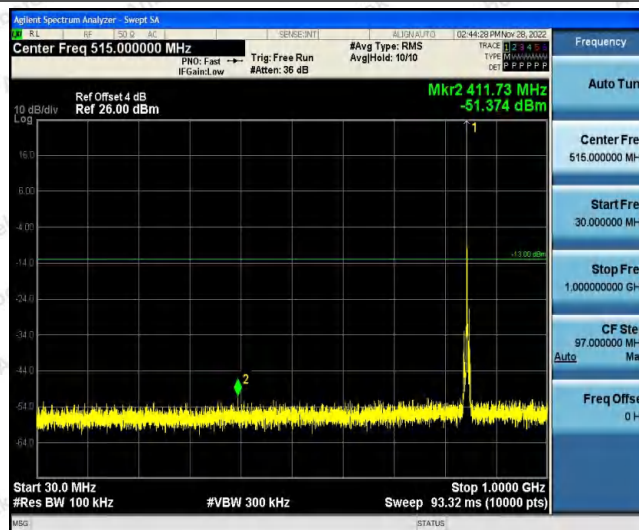

Band5-3MHz-16QAM-20635-1RB#0-Range2:1000~10000MHz

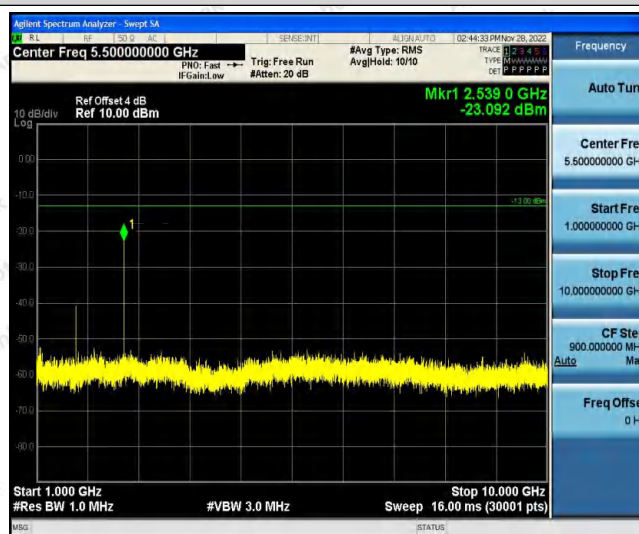

Band5-5MHz-QPSK-20425-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

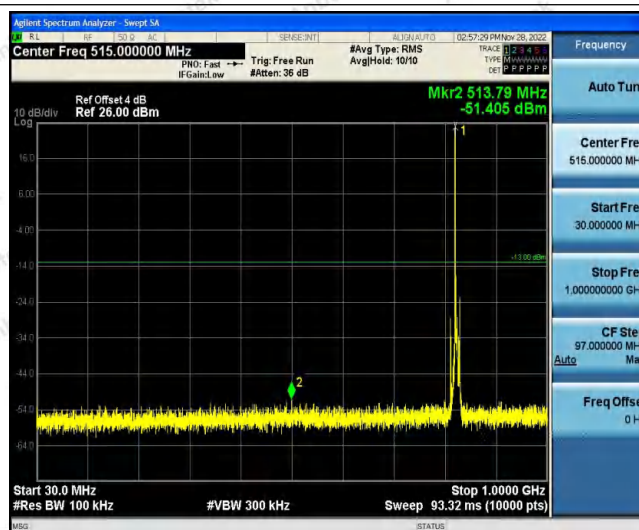

Band5-5MHz-QPSK-20425-1RB#0-Range2:1000~10000MHz

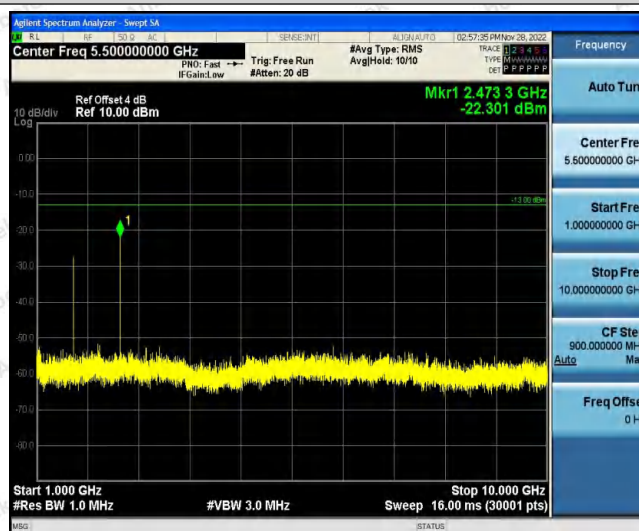

Band5-5MHz-QPSK-20525-1RB#0-Range1:30~1000MHz

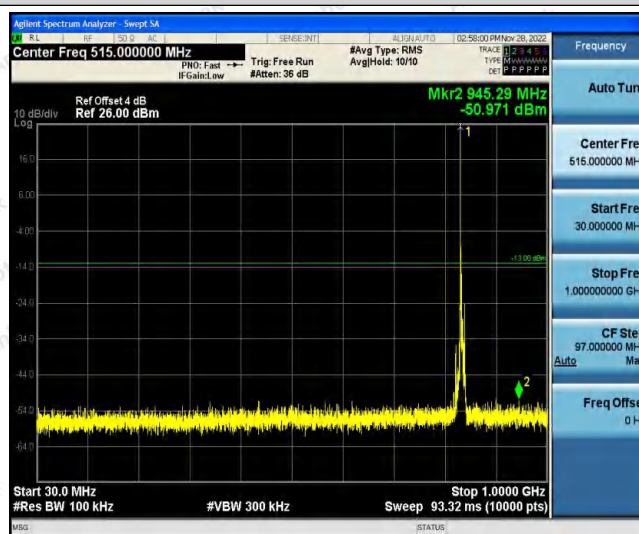

Band5-5MHz-QPSK-20525-1RB#0-Range2:1000~10000MHz

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com




Hotline

400-003-0500


www.anbotech.com

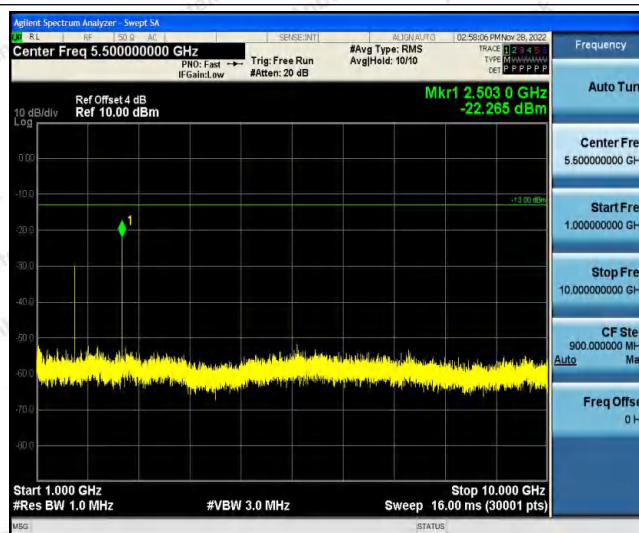

Band5-5MHz-QPSK-20625-1RB#0-Range1:30~1000MHz

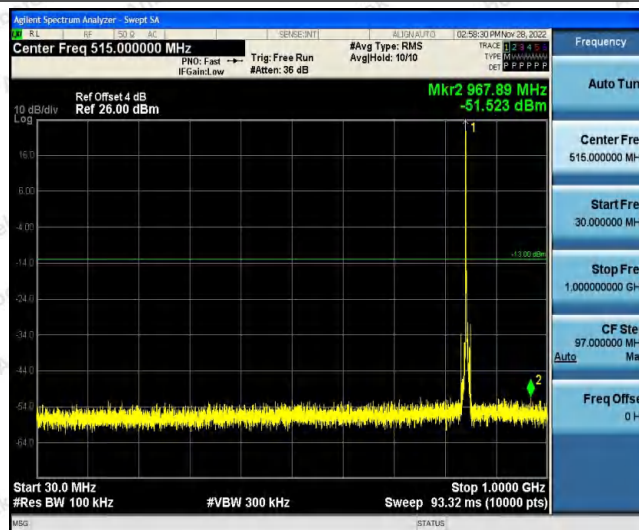

Band5-5MHz-QPSK-20625-1RB#0-Range2:1000~10000MHz

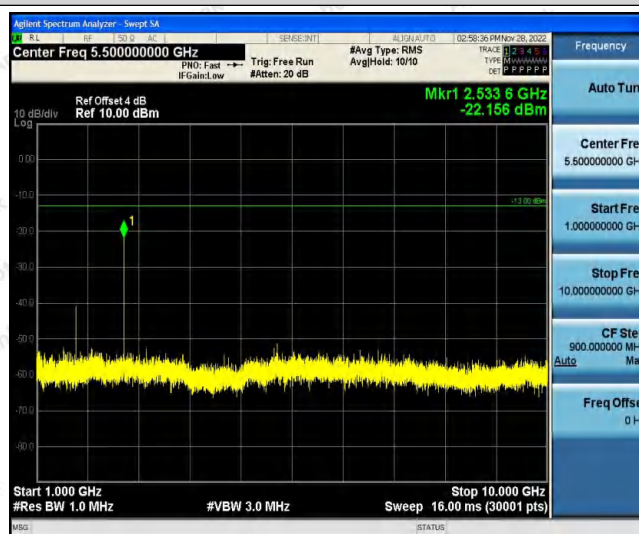

Band5-5MHz-16QAM-20425-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

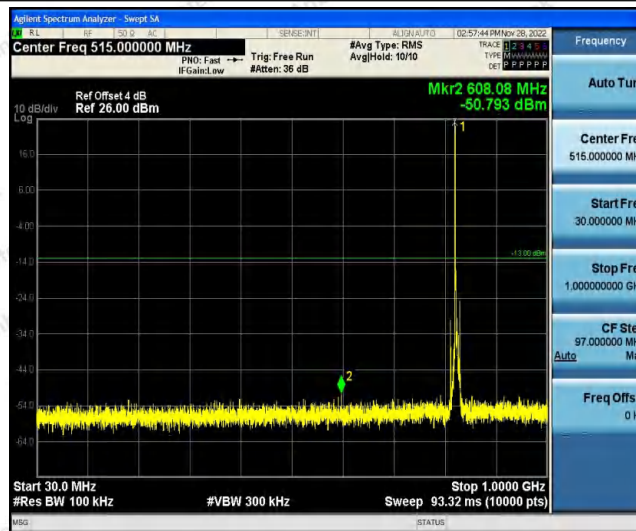

Band5-5MHz-16QAM-20425-1RB#0-Range2:1000~10000MHz

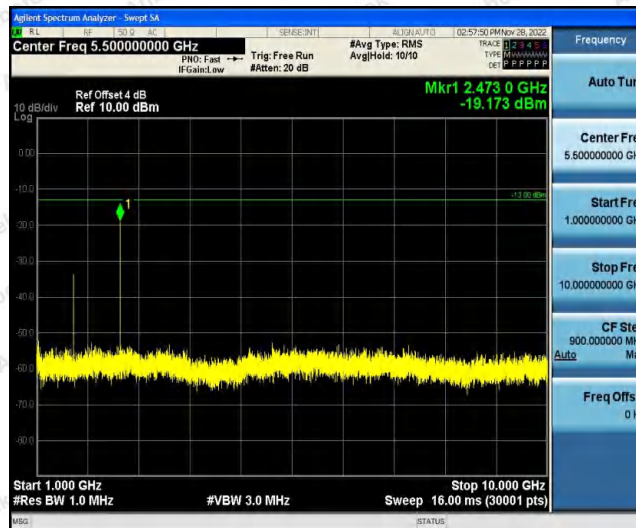

Band5-5MHz-16QAM-20525-1RB#0-Range1:30~1000MHz

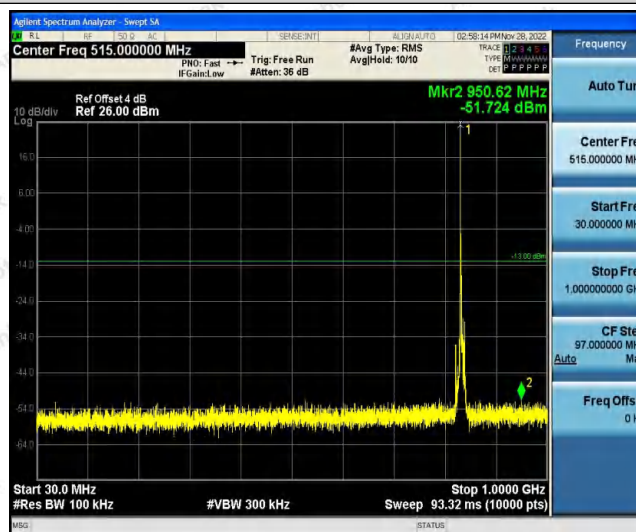

Band5-5MHz-16QAM-20525-1RB#0-Range2:1000~10000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

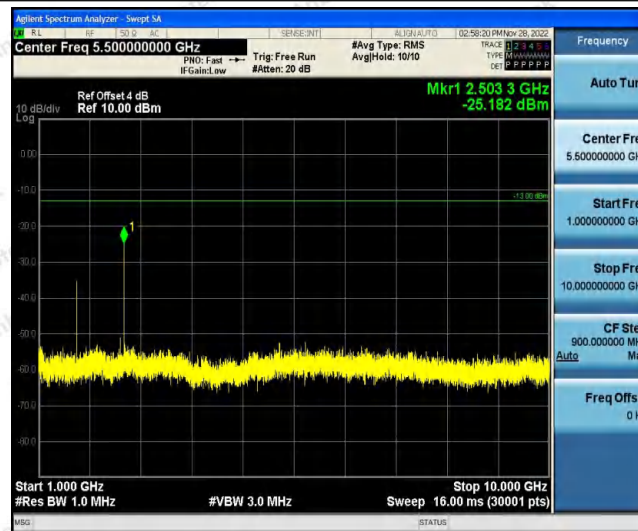

Band5-5MHz-16QAM-20625-1RB#0-Range1:30~1000MHz

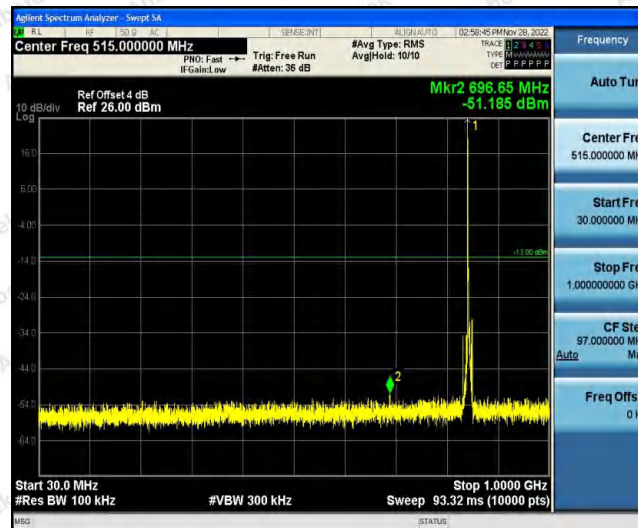

Band5-5MHz-16QAM-20625-1RB#0-Range2:1000~10000MHz

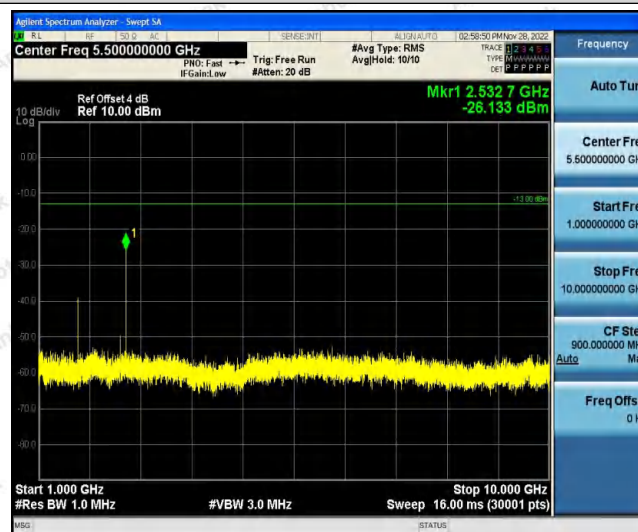

Band5-10MHz-QPSK-20450-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500


www.anbotek.com

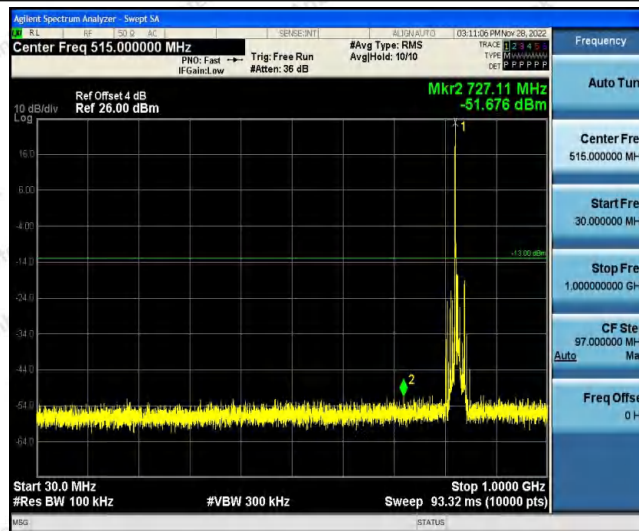

Band5-10MHz-QPSK-20450-1RB#0-Range2:1000~10000MHz



Band5-10MHz-QPSK-20525-1RB#0-Range1:30~1000MHz

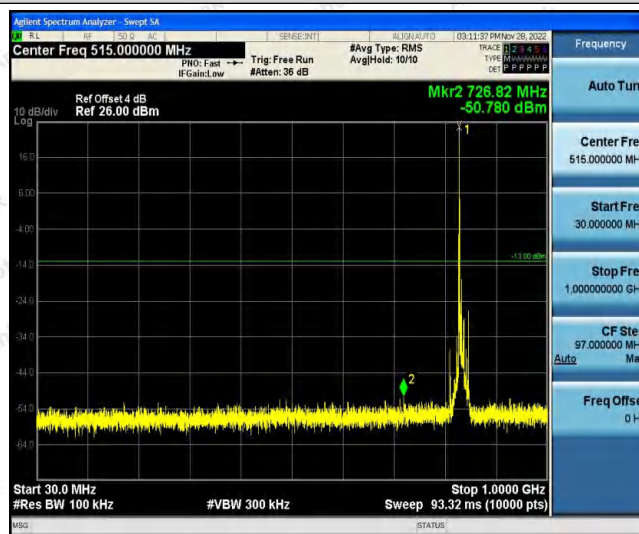

Band5-10MHz-QPSK-20525-1RB#0-Range2:1000~10000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

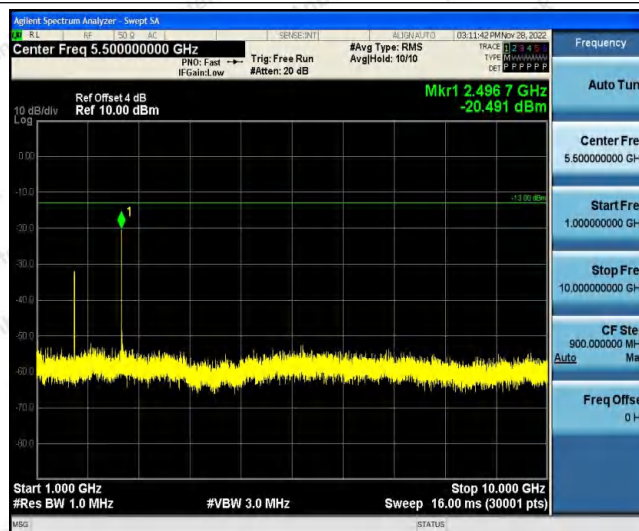

Band5-10MHz-QPSK-20600-1RB#0-Range1:30~1000MHz

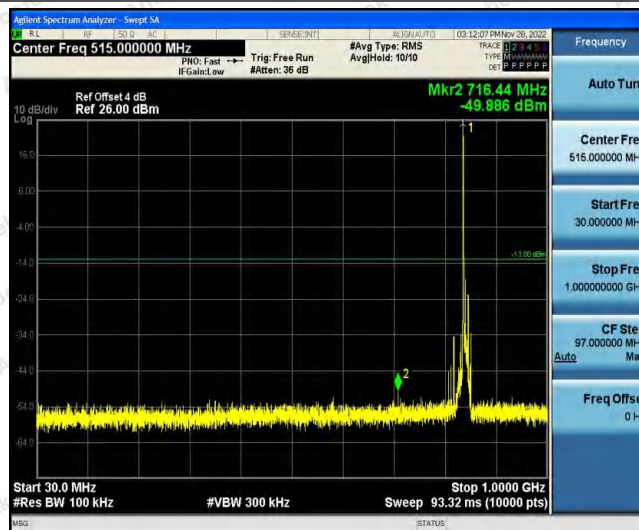

Band5-10MHz-QPSK-20600-1RB#0-Range2:1000~10000MHz

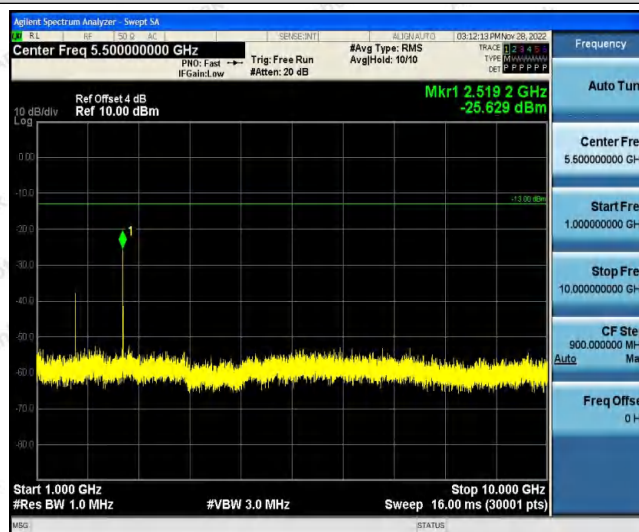

Band5-10MHz-16QAM-20450-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

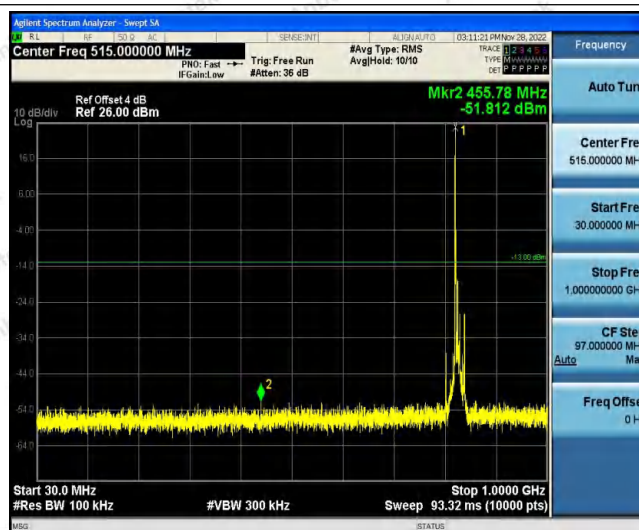

Band5-10MHz-16QAM-20450-1RB#0-Range2:1000~10000MHz

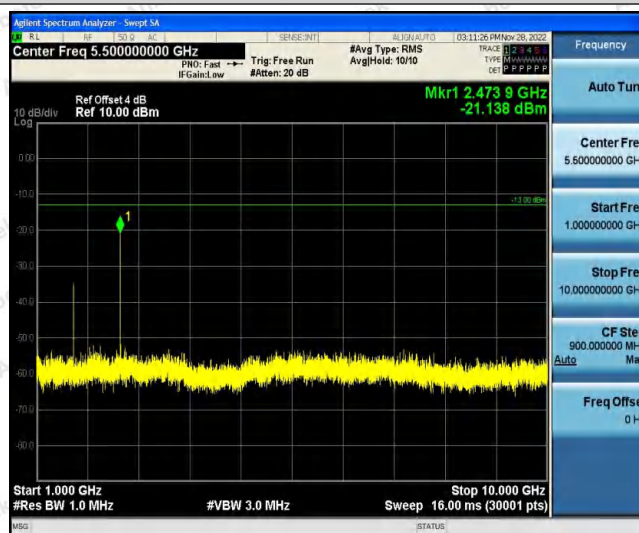

Band5-10MHz-16QAM-20525-1RB#0-Range1:30~1000MHz

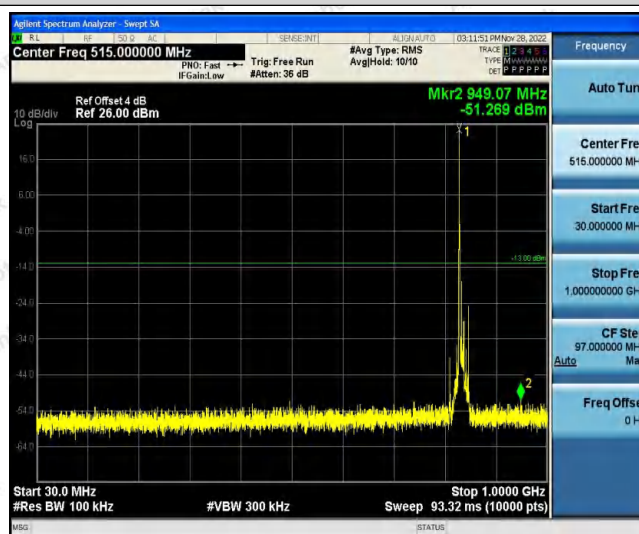

Band5-10MHz-16QAM-20525-1RB#0-Range2:1000~10000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com




Hotline

400-003-0500


www.anbotek.com

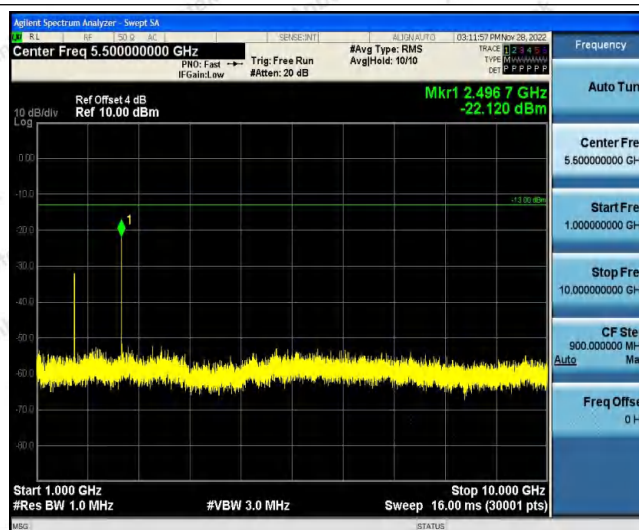

Band5-10MHz-16QAM-20600-1RB#0-Range1:30~1000MHz

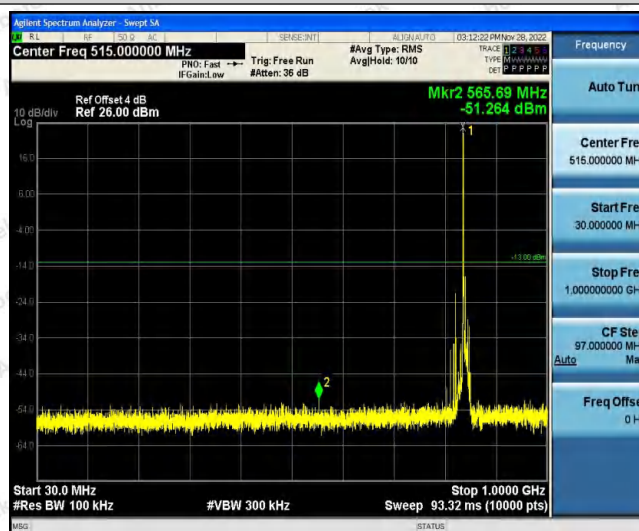

Band5-10MHz-16QAM-20600-1RB#0-Range2:1000~10000MHz

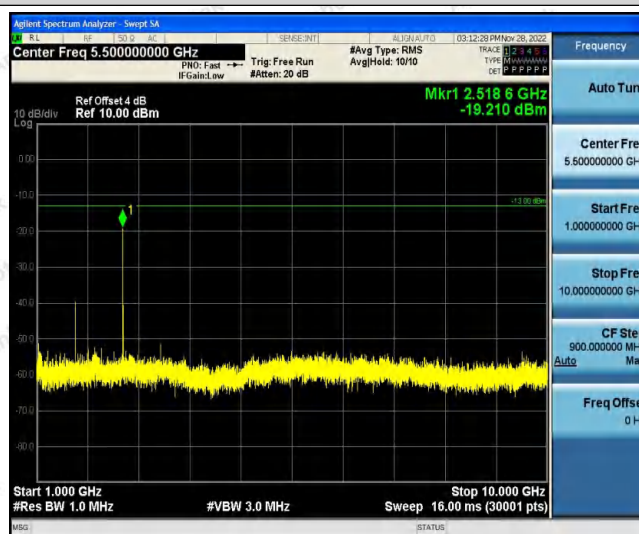

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Appendix F: Frequency stability VS Voltage measurement

Test Result

Band	Bandwidth	Modulation	Channel	RB Configure	Voltage		Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band5	1.4MHz	QPSK	20407	6RB#0	VL	NT	-10.91	-0.013229	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	VN	NT	-8.01	-0.009713	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	VH	NT	-9.58	-0.011616	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	VL	NT	-11.73	-0.014023	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	VN	NT	10.31	0.012325	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	VH	NT	-2.35	-0.002809	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	VL	NT	-11.39	-0.013427	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	VN	NT	-5.85	-0.006896	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	VH	NT	-13.19	-0.015549	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	VL	NT	-8.01	-0.009713	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	VN	NT	1.99	0.002413	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	VH	NT	-9.78	-0.011859	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	VL	NT	4.56	0.005451	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	VN	NT	-3.49	-0.004172	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	VH	NT	-8.75	-0.010460	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	VL	NT	-8.88	-0.010468	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	VN	NT	-4.39	-0.005175	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	VH	NT	-7.01	-0.008264	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	VL	NT	-15.35	-0.018595	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	VN	NT	-7.47	-0.009049	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	VH	NT	-8.41	-0.010188	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	VL	NT	-15.45	-0.018470	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	VN	NT	2.80	0.003347	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	VH	NT	-12.25	-0.014644	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	VL	NT	-12.77	-0.015068	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	VN	NT	-7.40	-0.008732	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	VH	NT	-4.52	-0.005333	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	VL	NT	-10.71	-0.012974	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	VN	NT	-13.26	-0.016063	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	VH	NT	-11.67	-0.014137	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	VL	NT	-12.22	-0.014608	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	VN	NT	-4.56	-0.005451	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	VH	NT	-13.12	-0.015684	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	VL	NT	-7.30	-0.008614	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band5	3MHz	16QAM	20635	15RB#0	VN	NT	-13.66	-0.016118	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	VH	NT	-11.23	-0.013251	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	VL	NT	-9.31	-0.011264	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	VN	NT	-10.51	-0.012716	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	VH	NT	-10.96	-0.013261	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	VL	NT	-3.28	-0.003921	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	VN	NT	-9.60	-0.011476	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	VH	NT	-10.87	-0.012995	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	VL	NT	-13.32	-0.015735	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	VN	NT	-12.13	-0.014330	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	VH	NT	-12.66	-0.014956	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	VL	NT	-6.45	-0.007804	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	VN	NT	-13.02	-0.015753	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	VH	NT	-11.10	-0.013430	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	VL	NT	-11.30	-0.013509	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	VN	NT	-2.60	-0.003108	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	VH	NT	-10.00	-0.011955	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	VL	NT	-18.47	-0.021819	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	VN	NT	-9.11	-0.010762	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	VH	NT	-13.23	-0.015629	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	VL	NT	-10.23	-0.012340	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	VN	NT	-6.72	-0.008106	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	VH	NT	-5.19	-0.006261	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	VL	NT	-6.88	-0.008225	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	VN	NT	-10.99	-0.013138	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	VH	NT	-7.88	-0.009420	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	VL	NT	-7.75	-0.009182	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	VN	NT	-10.11	-0.011979	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	VH	NT	-12.65	-0.014988	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	VL	NT	-8.74	-0.010543	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	VN	NT	-9.16	-0.011049	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	VH	NT	-4.94	-0.005959	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	VL	NT	-10.34	-0.012361	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	VN	NT	-6.12	-0.007316	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	VH	NT	-17.61	-0.021052	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	VL	NT	-10.27	-0.012168	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	VN	NT	-14.49	-0.017168	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	VH	NT	-15.21	-0.018021	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com

Appendix G: Frequency stability VS Temperature measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band5	1.4MHz	QPSK	20407	6RB#0	NV	-30	-8.94	-0.010840	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	NV	-20	-7.70	-0.009337	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	NV	0	-8.41	-0.010198	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	NV	10	-5.22	-0.006330	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	NV	20	-3.66	-0.004438	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	-30	-6.64	-0.007938	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	-20	-8.23	-0.009839	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	0	-5.56	-0.006647	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	10	4.59	0.005487	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	20	-6.71	-0.008022	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	NV	-30	-3.78	-0.004456	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	NV	-20	-8.44	-0.009949	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	NV	0	-9.40	-0.011081	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	NV	10	-12.66	-0.014924	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	NV	20	-8.55	-0.010079	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	NV	-30	-13.25	-0.016066	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	NV	-20	-9.96	-0.012077	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	NV	0	-10.81	-0.013108	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	NV	10	2.63	0.003189	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	NV	20	-7.24	-0.008779	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	NV	-30	-2.07	-0.002475	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	NV	-20	-9.57	-0.011441	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	NV	0	-11.84	-0.014154	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	NV	10	-10.04	-0.012002	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	NV	20	-4.55	-0.005439	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	NV	-30	-11.33	-0.013356	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	NV	-20	-11.06	-0.013038	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	NV	0	-9.93	-0.011706	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	NV	10	-8.58	-0.010114	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	NV	20	-3.15	-0.003713	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	NV	-30	-9.67	-0.011714	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	NV	-20	-5.69	-0.006893	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	NV	0	-4.11	-0.004979	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	NV	10	-11.72	-0.014197	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	NV	20	-5.62	-0.006808	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

Band5	3MHz	QPSK	20525	15RB#0	NV	-30	-5.14	-0.006145	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	-20	-8.13	-0.009719	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	0	-4.42	-0.005284	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	10	-14.41	-0.017227	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	20	-12.37	-0.014788	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	NV	-30	-8.23	-0.009711	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	NV	-20	-9.93	-0.011717	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	NV	0	-10.97	-0.012944	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	NV	10	-12.06	-0.014230	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	NV	20	-11.64	-0.013735	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	NV	-30	-10.91	-0.013216	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	NV	-20	-9.11	-0.011036	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	NV	0	-12.20	-0.014779	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	NV	10	-5.88	-0.007123	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	NV	20	-8.97	-0.010866	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	NV	-30	-8.84	-0.010568	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	NV	-20	-11.74	-0.014035	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	NV	0	-9.63	-0.011512	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	NV	10	-11.10	-0.013270	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	NV	20	3.48	0.004160	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	NV	-30	-9.56	-0.011280	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	NV	-20	-10.93	-0.012897	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	NV	0	-11.30	-0.013333	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	NV	10	-10.13	-0.011953	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	NV	20	-4.96	-0.005853	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	NV	-30	-2.43	-0.002940	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	NV	-20	-6.78	-0.008203	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	NV	0	-7.08	-0.008566	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	NV	10	-12.39	-0.014991	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	NV	20	-11.04	-0.013358	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	-30	-10.16	-0.012146	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	-20	-6.31	-0.007543	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	0	-5.82	-0.006958	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	10	-11.00	-0.013150	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	20	-10.84	-0.012959	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	NV	-30	-12.33	-0.014566	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	NV	-20	-11.32	-0.013373	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	NV	0	-8.13	-0.009604	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	NV	10	-10.57	-0.012487	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	NV	20	-9.68	-0.011435	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	NV	-30	-14.03	-0.016975	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

Band5	5MHz	16QAM	20425	25RB#0	NV	-20	-14.08	-0.017036	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	NV	0	-12.43	-0.015039	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	NV	10	-10.79	-0.013055	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	NV	20	-9.83	-0.011894	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	NV	-30	-8.73	-0.010436	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	NV	-20	-12.53	-0.014979	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	NV	0	-10.21	-0.012206	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	NV	10	-4.71	-0.005631	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	NV	20	-2.89	-0.003455	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	NV	-30	-9.97	-0.011778	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	NV	-20	-11.73	-0.013857	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	NV	0	-8.11	-0.009581	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	NV	10	-13.66	-0.016137	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	NV	20	-13.10	-0.015475	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	NV	-30	-9.10	-0.010977	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	NV	-20	-7.17	-0.008649	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	NV	0	-10.69	-0.012895	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	NV	10	-5.65	-0.006815	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	NV	20	-10.70	-0.012907	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	-30	-15.12	-0.018075	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	-20	-9.14	-0.010926	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	0	-14.72	-0.017597	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	10	-13.83	-0.016533	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	20	-4.19	-0.005009	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	NV	-30	-10.17	-0.012050	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	NV	-20	-10.91	-0.012927	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	NV	0	-11.16	-0.013223	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	NV	10	-8.05	-0.009538	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	NV	20	-12.67	-0.015012	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	NV	-30	-8.17	-0.009855	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	NV	-20	-11.69	-0.014101	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	NV	0	-9.43	-0.011375	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	NV	10	-4.96	-0.005983	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	NV	20	-11.67	-0.014077	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	NV	-30	-9.04	-0.010807	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	NV	-20	-16.38	-0.019582	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	NV	0	-5.12	-0.006121	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	NV	10	-8.34	-0.009970	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	NV	20	-10.54	-0.012600	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	NV	-30	-6.88	-0.008152	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	NV	-20	-10.37	-0.012287	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

Band5	10MHz	16QAM	20600	50RB#0	NV	0	-4.29	-0.005083	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	NV	10	-10.91	-0.012927	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	NV	20	-13.58	-0.016090	±2.5	PASS

---End---

