



Band2-5MHz-QPSK-18625-1RB#24



Band2-5MHz-QPSK-18625-25RB#0



Band2-5MHz-QPSK-19175-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500

www.anbotek.com



Band2-5MHz-QPSK-19175-1RB#24

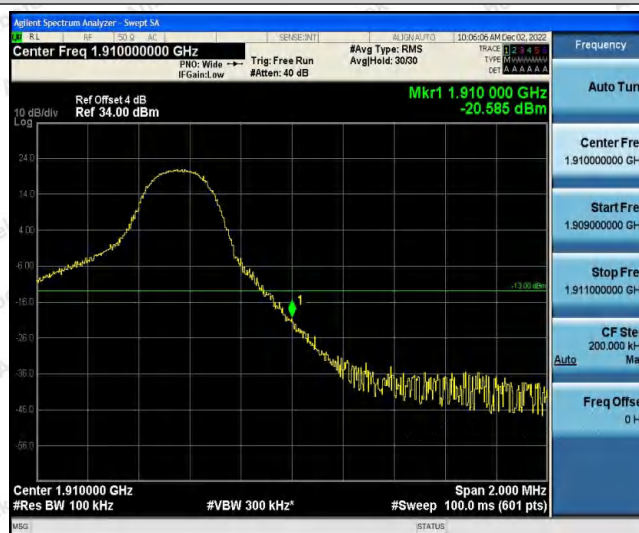

Band2-5MHz-QPSK-19175-25RB#0



Band2-5MHz-16QAM-18625-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Band2-5MHz-16QAM-18625-1RB#24



Band2-5MHz-16QAM-18625-25RB#0



Band2-5MHz-16QAM-19175-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500

www.anbotek.com



Band2-5MHz-16QAM-19175-1RB#24

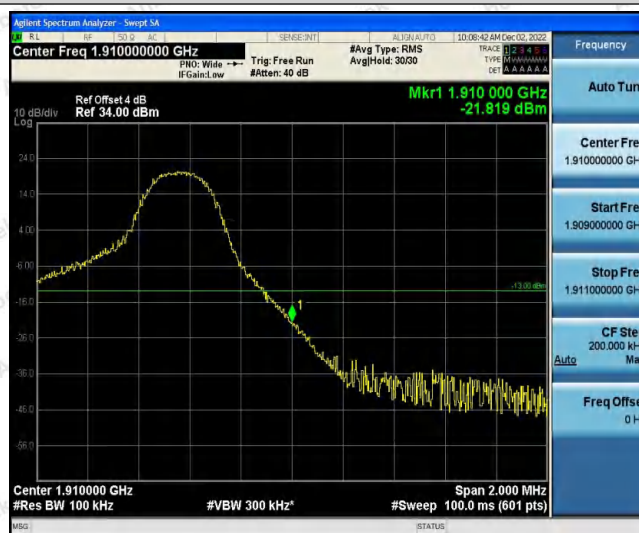

Band2-5MHz-16QAM-19175-25RB#0



Band2-10MHz-QPSK-18650-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

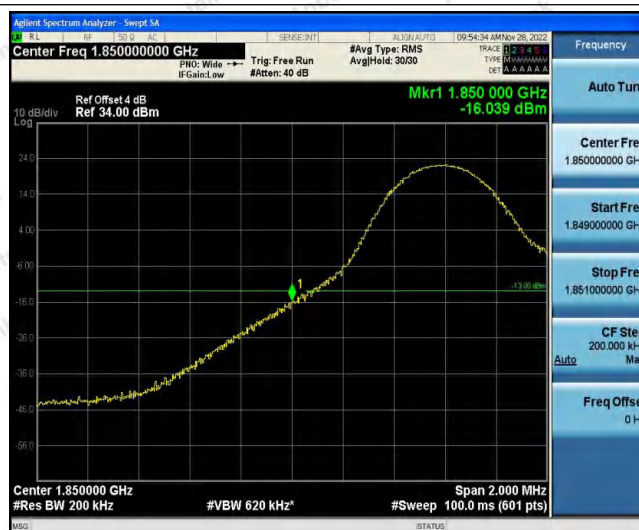

Band2-10MHz-QPSK-18650-1RB#49



Band2-10MHz-QPSK-18650-50RB#0



Band2-10MHz-QPSK-19150-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Band2-10MHz-QPSK-19150-1RB#49



Band2-10MHz-QPSK-19150-50RB#0



Band2-10MHz-16QAM-18650-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

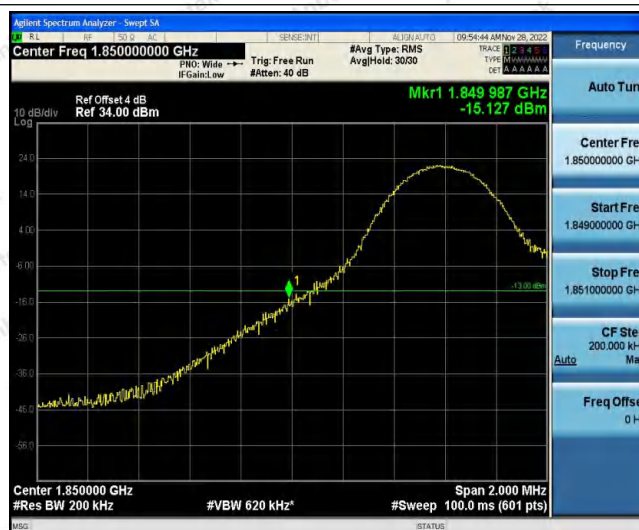

Band2-10MHz-16QAM-18650-1RB#49



Band2-10MHz-16QAM-18650-50RB#0



Band2-10MHz-16QAM-19150-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Band2-10MHz-16QAM-19150-1RB#49



Band2-10MHz-16QAM-19150-50RB#0



Band2-15MHz-QPSK-18675-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Band2-15MHz-QPSK-18675-1RB#74



Band2-15MHz-QPSK-18675-75RB#0



Band2-15MHz-QPSK-19125-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Band2-15MHz-QPSK-19125-1RB#74



Band2-15MHz-QPSK-19125-75RB#0



Band2-15MHz-16QAM-18675-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



Band2-15MHz-16QAM-18675-1RB#74



Band2-15MHz-16QAM-18675-75RB#0



Band2-15MHz-16QAM-19125-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Band2-15MHz-16QAM-19125-1RB#74



Band2-15MHz-16QAM-19125-75RB#0



Band2-20MHz-QPSK-18700-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



Band2-20MHz-QPSK-18700-1RB#99



Band2-20MHz-QPSK-18700-100RB#0



Band2-20MHz-QPSK-19100-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Band2-20MHz-QPSK-19100-1RB#99



Band2-20MHz-QPSK-19100-100RB#0



Band2-20MHz-16QAM-18700-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Band2-20MHz-16QAM-18700-1RB#99



Band2-20MHz-16QAM-18700-100RB#0



Band2-20MHz-16QAM-19100-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

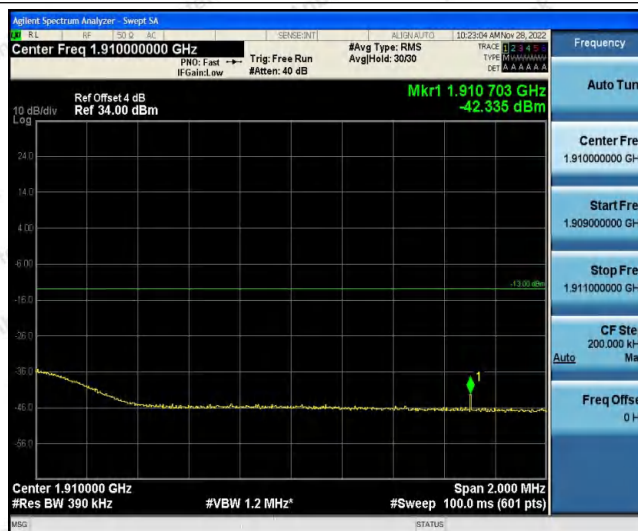

Band2-20MHz-16QAM-19100-1RB#99



Band2-20MHz-16QAM-19100-100RB#0

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1RB#0	Range1:30~1000MHz	-47.68	PASS
Band2	1.4MHz	QPSK	18607	1RB#0	Range2:1000~20000MHz	-33.29	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-47.47	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-33.48	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	Range1:30~1000MHz	-48.38	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	Range2:1000~20000MHz	-32.55	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	Range1:30~1000MHz	-47.3	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	Range2:1000~20000MHz	-33.67	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-47.26	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-32.87	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	Range1:30~1000MHz	-47.8	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	Range2:1000~20000MHz	-33.52	PASS
Band2	3MHz	QPSK	18615	1RB#0	Range1:30~1000MHz	-48.18	PASS
Band2	3MHz	QPSK	18615	1RB#0	Range2:1000~20000MHz	-32.73	PASS
Band2	3MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-48.05	PASS
Band2	3MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-32.72	PASS
Band2	3MHz	QPSK	19185	1RB#0	Range1:30~1000MHz	-47.44	PASS
Band2	3MHz	QPSK	19185	1RB#0	Range2:1000~20000MHz	-33.76	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

Band2	3MHz	16QAM	18615	1RB#0	Range1:30~1000MHz	-48.73	PASS
Band2	3MHz	16QAM	18615	1RB#0	Range2:1000~20000MHz	-33.43	PASS
Band2	3MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-48.8	PASS
Band2	3MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-31.83	PASS
Band2	3MHz	16QAM	19185	1RB#0	Range1:30~1000MHz	-48.38	PASS
Band2	3MHz	16QAM	19185	1RB#0	Range2:1000~20000MHz	-33.7	PASS
Band2	5MHz	QPSK	18625	1RB#0	Range1:30~1000MHz	-48.09	PASS
Band2	5MHz	QPSK	18625	1RB#0	Range2:1000~20000MHz	-33.01	PASS
Band2	5MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-48.44	PASS
Band2	5MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-32.99	PASS
Band2	5MHz	QPSK	19175	1RB#0	Range1:30~1000MHz	-47.73	PASS
Band2	5MHz	QPSK	19175	1RB#0	Range2:1000~20000MHz	-32.81	PASS
Band2	5MHz	16QAM	18625	1RB#0	Range1:30~1000MHz	-47.55	PASS
Band2	5MHz	16QAM	18625	1RB#0	Range2:1000~20000MHz	-33.53	PASS
Band2	5MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-48.01	PASS
Band2	5MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-32.49	PASS
Band2	5MHz	16QAM	19175	1RB#0	Range1:30~1000MHz	-47.77	PASS
Band2	5MHz	16QAM	19175	1RB#0	Range2:1000~20000MHz	-33.6	PASS
Band2	10MHz	QPSK	18650	1RB#0	Range1:30~1000MHz	-48.9	PASS
Band2	10MHz	QPSK	18650	1RB#0	Range2:1000~20000MHz	-33.31	PASS
Band2	10MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-47.65	PASS
Band2	10MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-33.33	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

Band2	10MHz	QPSK	19150	1RB#0	Range1:30~1000MHz	-47.85	PASS
Band2	10MHz	QPSK	19150	1RB#0	Range2:1000~20000MHz	-33.42	PASS
Band2	10MHz	16QAM	18650	1RB#0	Range1:30~1000MHz	-47.93	PASS
Band2	10MHz	16QAM	18650	1RB#0	Range2:1000~20000MHz	-33.23	PASS
Band2	10MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-48.42	PASS
Band2	10MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-33.7	PASS
Band2	10MHz	16QAM	19150	1RB#0	Range1:30~1000MHz	-47.24	PASS
Band2	10MHz	16QAM	19150	1RB#0	Range2:1000~20000MHz	-33.43	PASS
Band2	15MHz	QPSK	18675	1RB#0	Range1:30~1000MHz	-47.27	PASS
Band2	15MHz	QPSK	18675	1RB#0	Range2:1000~20000MHz	-33.39	PASS
Band2	15MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-47.67	PASS
Band2	15MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-32.57	PASS
Band2	15MHz	QPSK	19125	1RB#0	Range1:30~1000MHz	-48.22	PASS
Band2	15MHz	QPSK	19125	1RB#0	Range2:1000~20000MHz	-33.18	PASS
Band2	15MHz	16QAM	18675	1RB#0	Range1:30~1000MHz	-47.81	PASS
Band2	15MHz	16QAM	18675	1RB#0	Range2:1000~20000MHz	-33.51	PASS
Band2	15MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-47.94	PASS
Band2	15MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-33.03	PASS
Band2	15MHz	16QAM	19125	1RB#0	Range1:30~1000MHz	-48.19	PASS
Band2	15MHz	16QAM	19125	1RB#0	Range2:1000~20000MHz	-32.36	PASS
Band2	20MHz	QPSK	18700	1RB#0	Range1:30~1000MHz	-48.13	PASS
Band2	20MHz	QPSK	18700	1RB#0	Range2:1000~20000MHz	-32.45	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

Band2	20MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-46.85	PASS
Band2	20MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-33.36	PASS
Band2	20MHz	QPSK	19100	1RB#0	Range1:30~1000MHz	-46.96	PASS
Band2	20MHz	QPSK	19100	1RB#0	Range2:1000~20000MHz	-32.98	PASS
Band2	20MHz	16QAM	18700	1RB#0	Range1:30~1000MHz	-47.16	PASS
Band2	20MHz	16QAM	18700	1RB#0	Range2:1000~20000MHz	-33.4	PASS
Band2	20MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-48.02	PASS
Band2	20MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-33.73	PASS
Band2	20MHz	16QAM	19100	1RB#0	Range1:30~1000MHz	-47.9	PASS
Band2	20MHz	16QAM	19100	1RB#0	Range2:1000~20000MHz	-32.8	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com

Test Graphs


Band2-1.4MHz-QPSK-18607-1RB#0-Range1:30~1000MHz

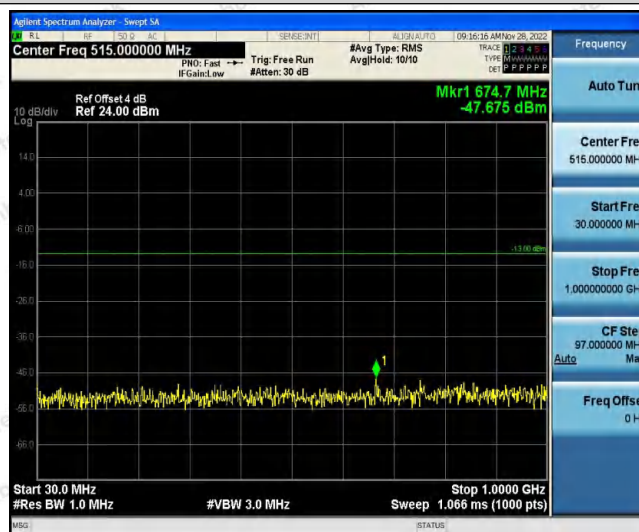

Band2-1.4MHz-QPSK-18607-1RB#0-Range2:1000~20000MHz

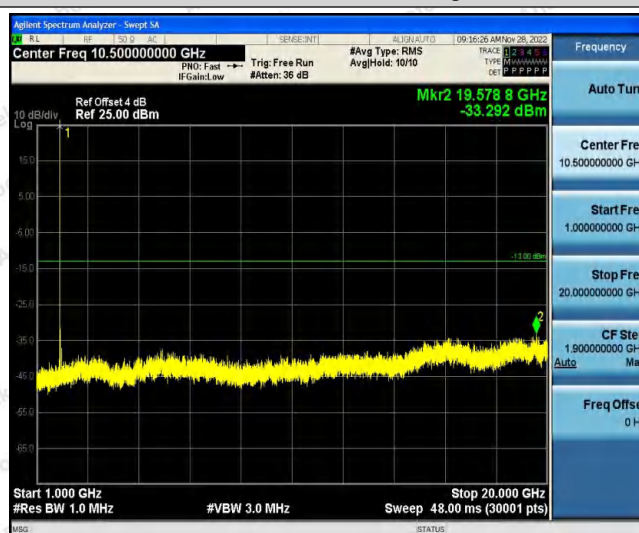

Band2-1.4MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

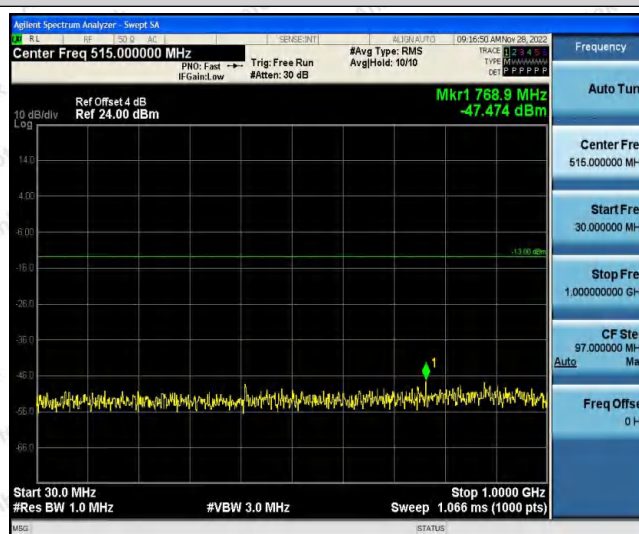

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline


400-003-0500

www.anbotek.com


Band2-1.4MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

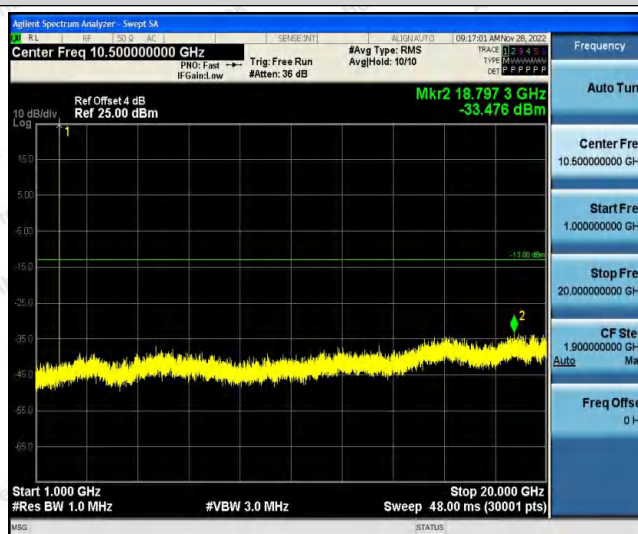

Band2-1.4MHz-QPSK-19193-1RB#0-Range1:30~1000MHz

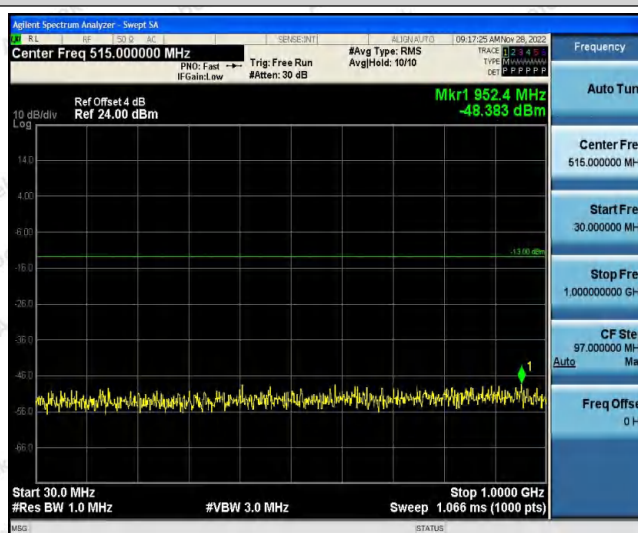

Band2-1.4MHz-QPSK-19193-1RB#0-Range2:1000~20000MHz

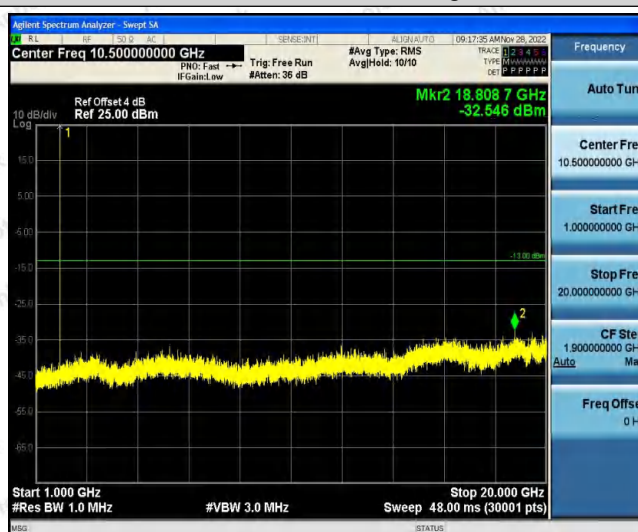

Band2-1.4MHz-16QAM-18607-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

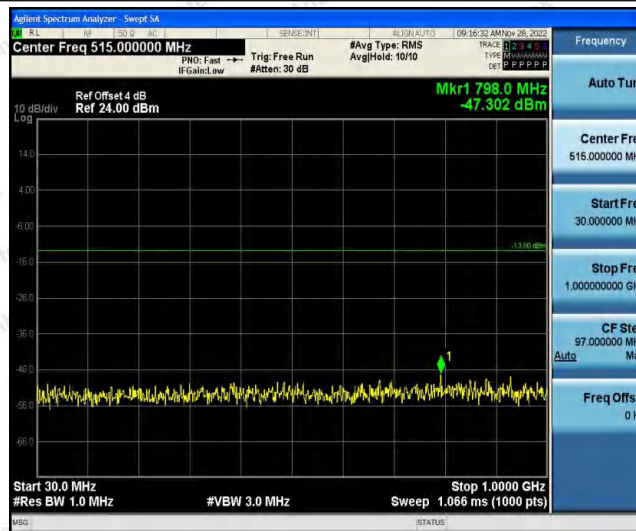

Band2-1.4MHz-16QAM-18607-1RB#0-Range2:1000~20000MHz

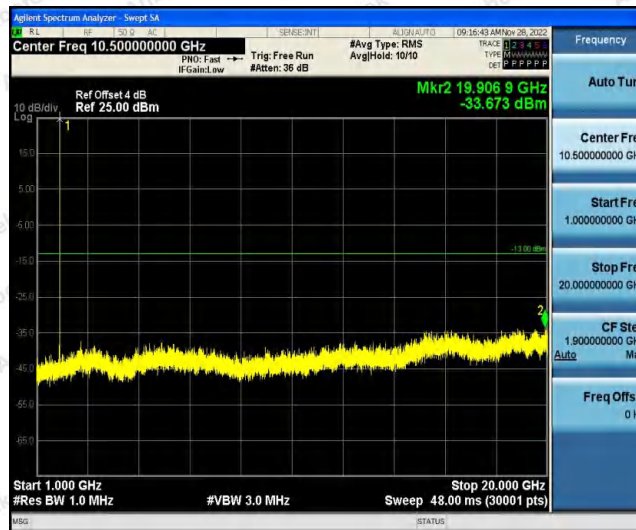

Band2-1.4MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

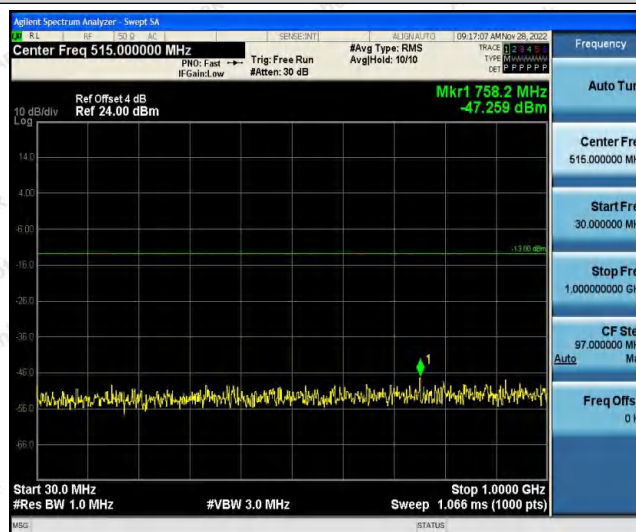

Band2-1.4MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

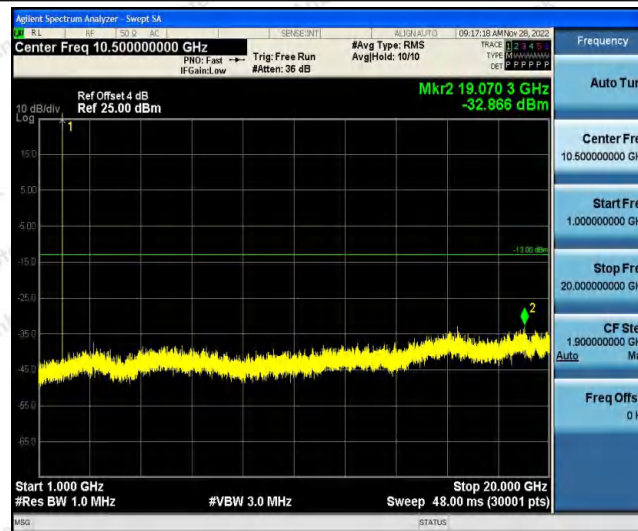

Band2-1.4MHz-16QAM-19193-1RB#0-Range1:30~1000MHz

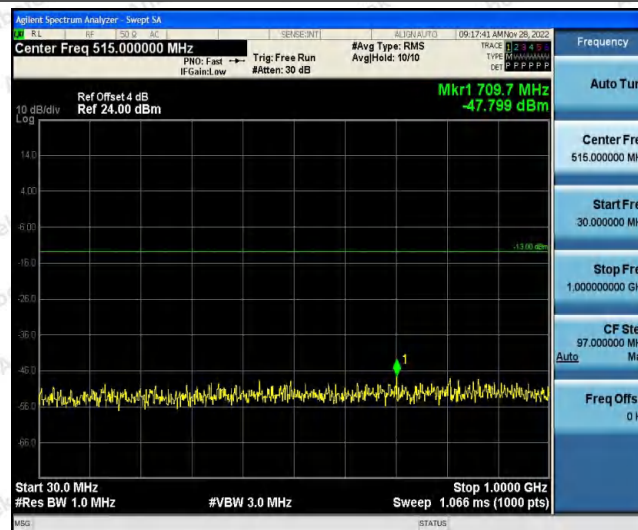

Band2-1.4MHz-16QAM-19193-1RB#0-Range2:1000~20000MHz

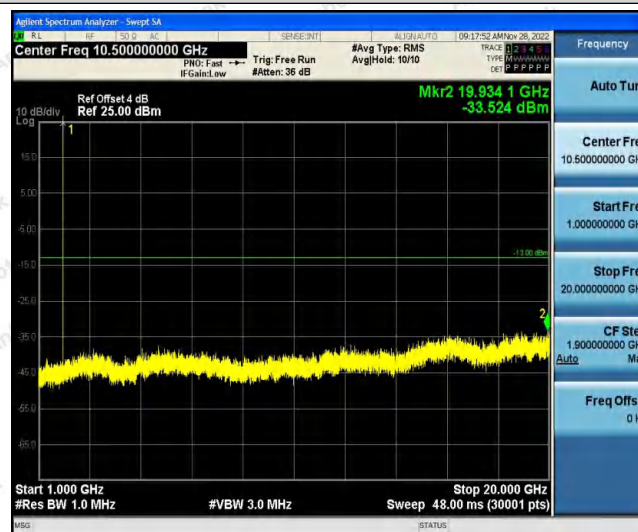

Band2-3MHz-QPSK-18615-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

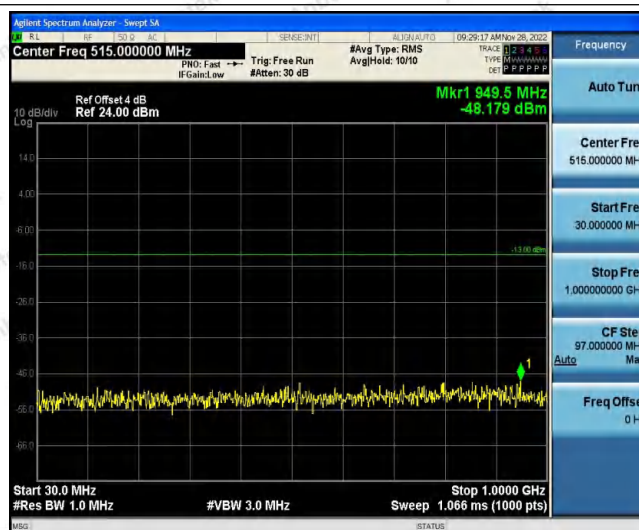

Band2-3MHz-QPSK-18615-1RB#0-Range2:1000~20000MHz

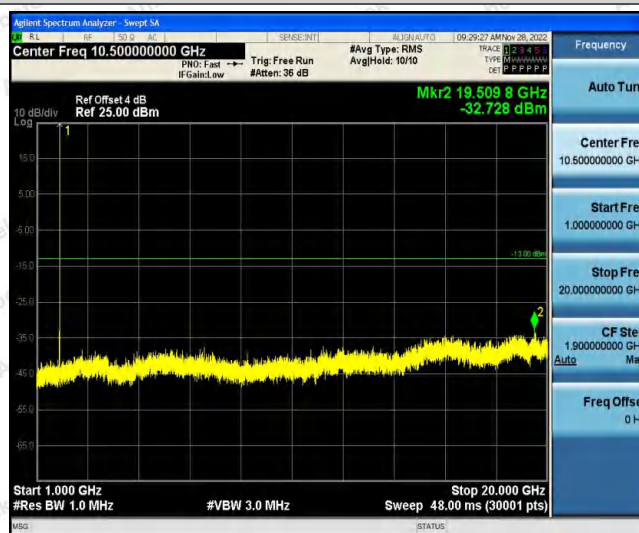

Band2-3MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

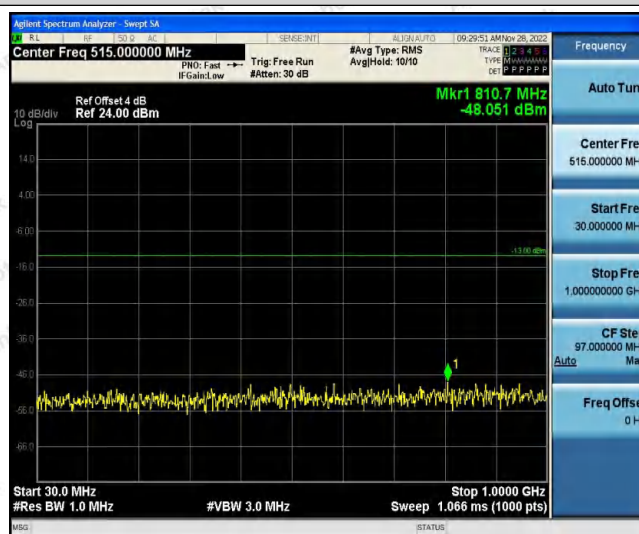

Band2-3MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

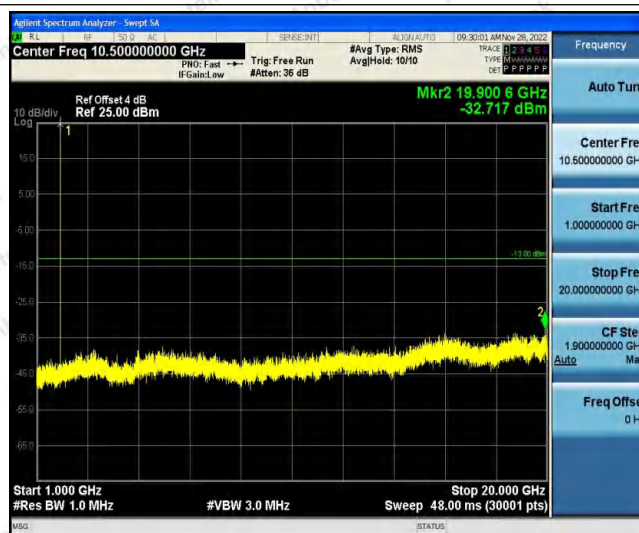

Band2-3MHz-QPSK-19185-1RB#0-Range1:30~1000MHz

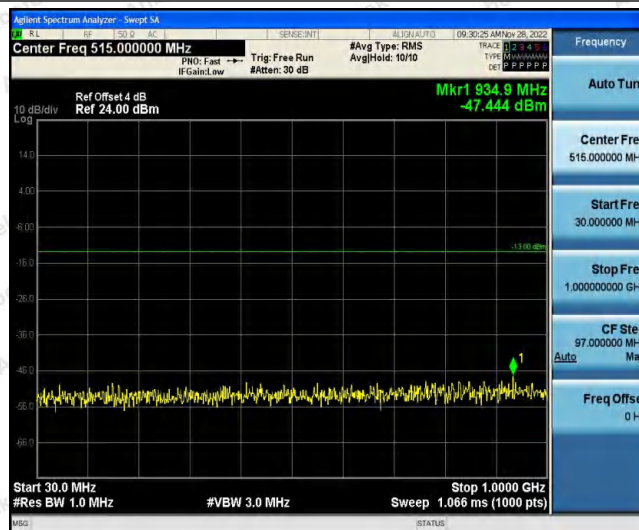

Band2-3MHz-QPSK-19185-1RB#0-Range2:1000~20000MHz

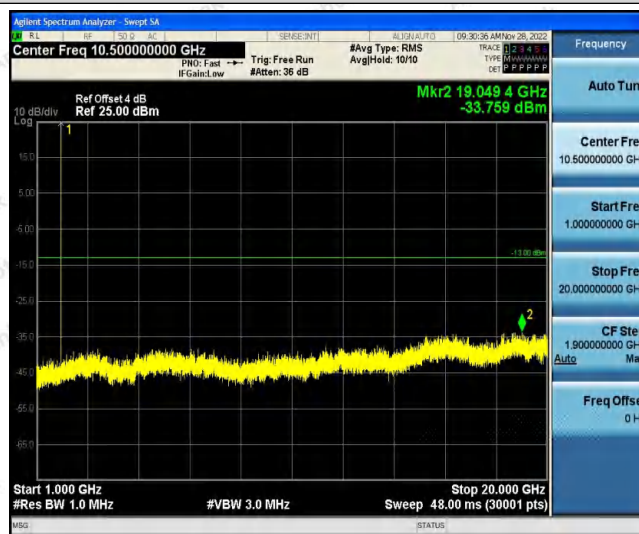

Band2-3MHz-16QAM-18615-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

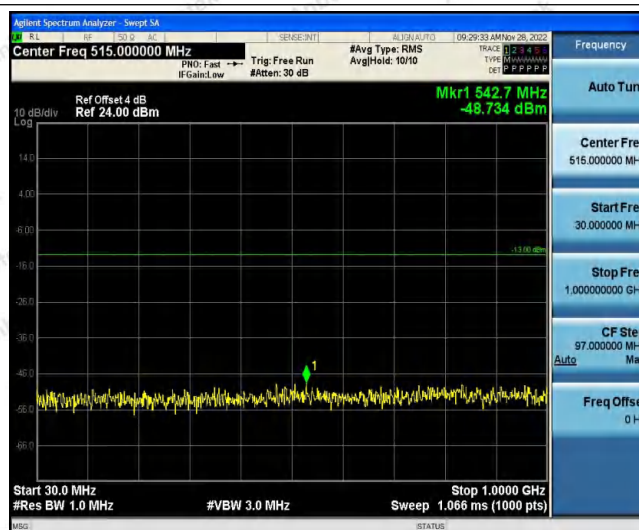

Band2-3MHz-16QAM-18615-1RB#0-Range2:1000~20000MHz

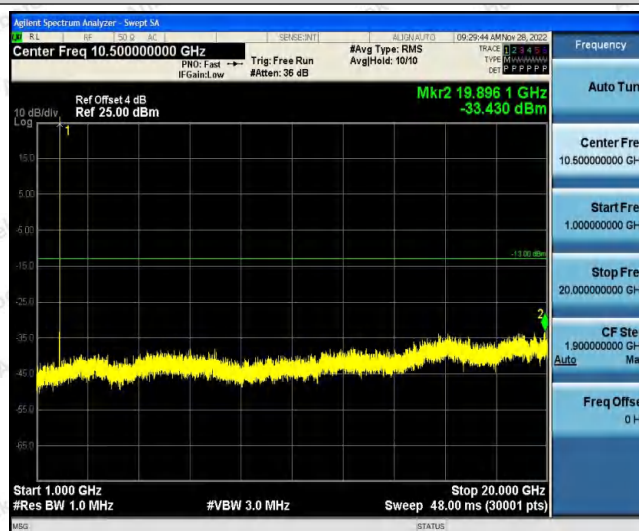

Band2-3MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

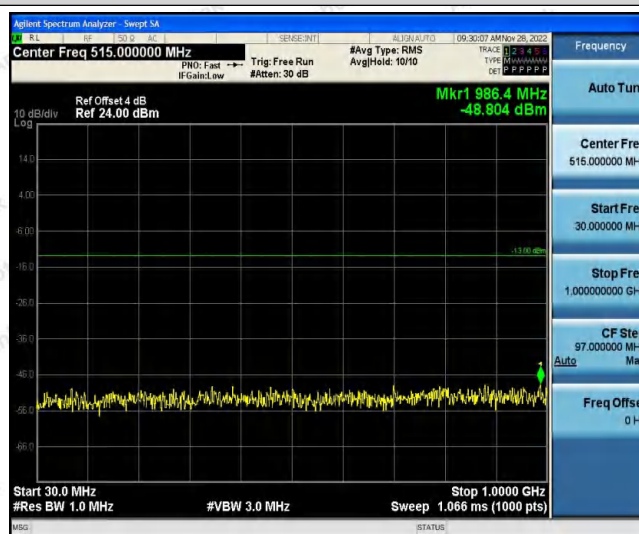

Band2-3MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

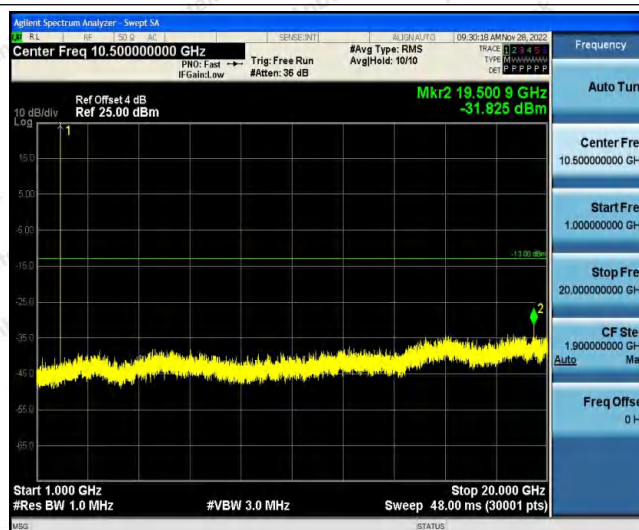

Band2-3MHz-16QAM-19185-1RB#0-Range1:30~1000MHz

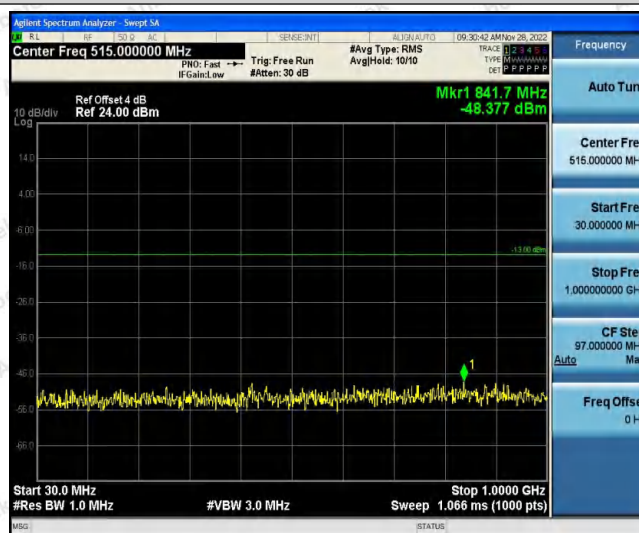

Band2-3MHz-16QAM-19185-1RB#0-Range2:1000~20000MHz

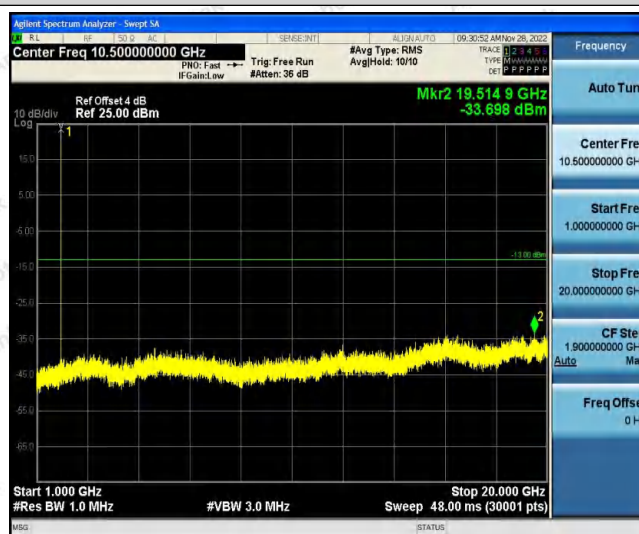

Band2-5MHz-QPSK-18625-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

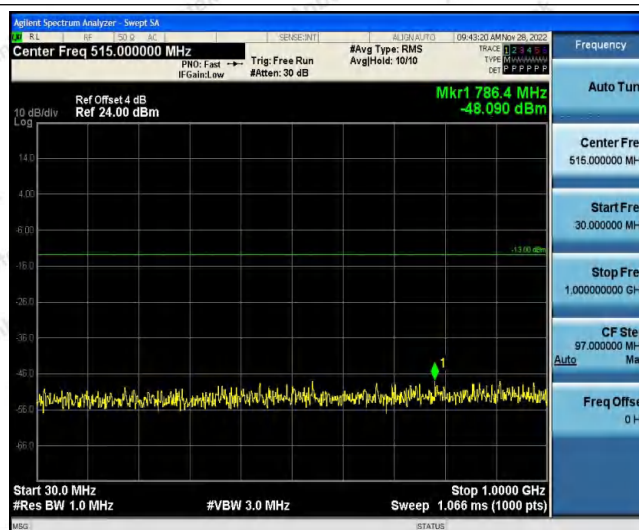

Band2-5MHz-QPSK-18625-1RB#0-Range2:1000~20000MHz

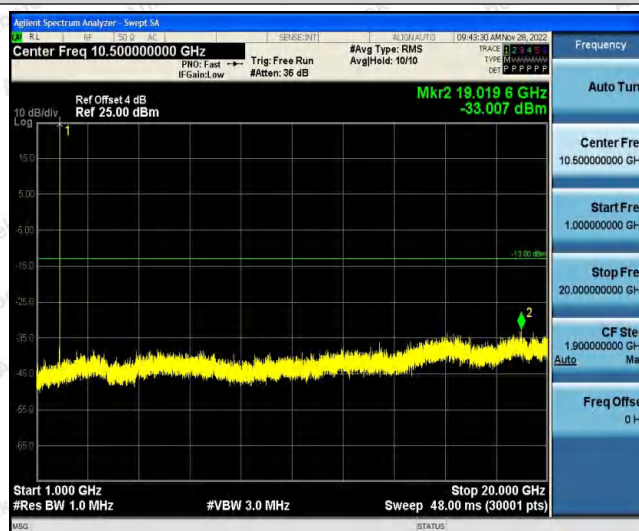

Band2-5MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

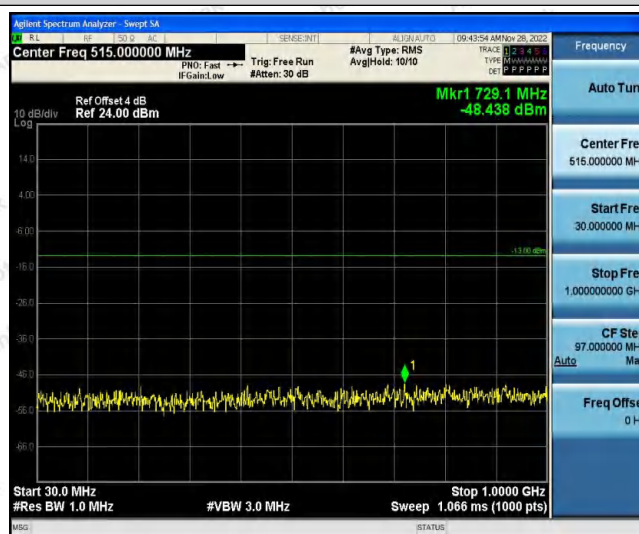

Band2-5MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

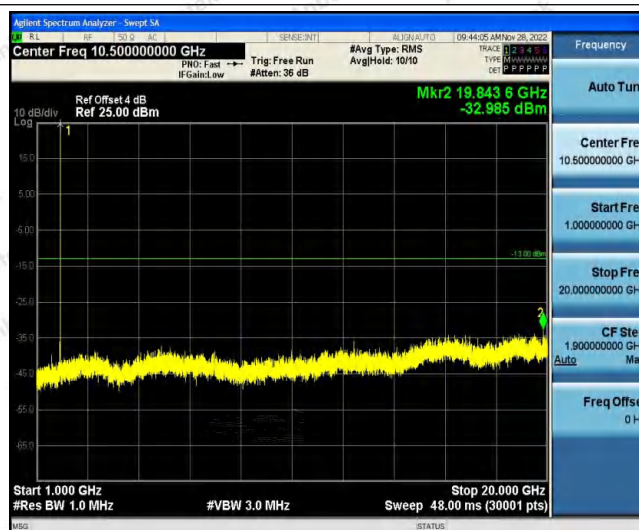

Band2-5MHz-QPSK-19175-1RB#0-Range1:30~1000MHz

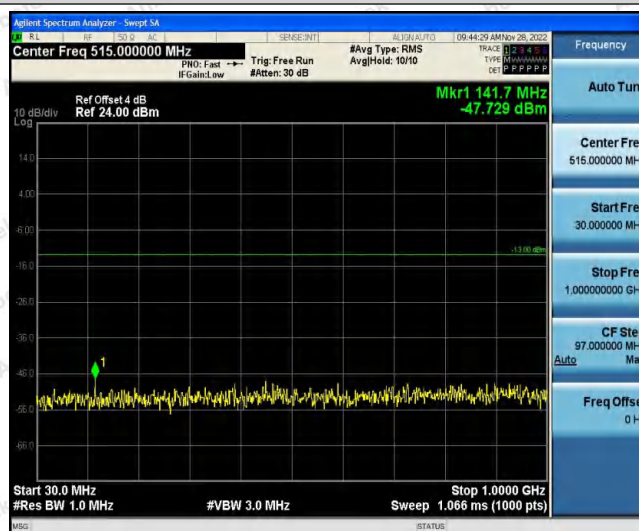

Band2-5MHz-QPSK-19175-1RB#0-Range2:1000~20000MHz

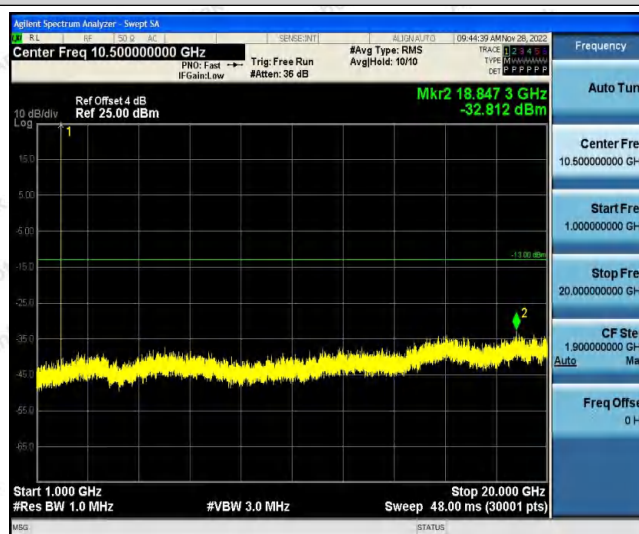

Band2-5MHz-16QAM-18625-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

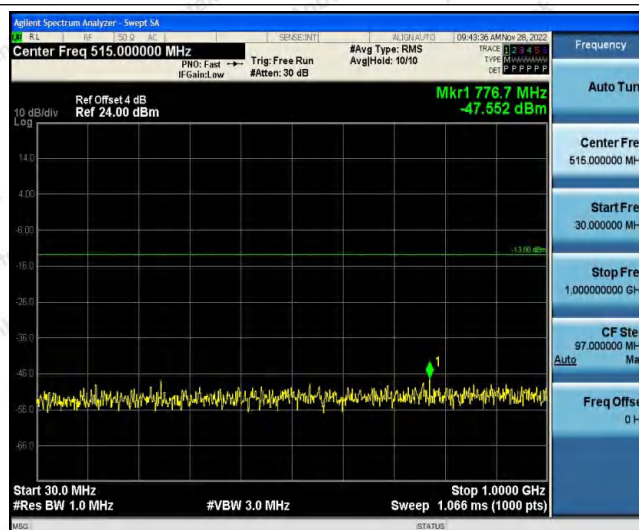

Band2-5MHz-16QAM-18625-1RB#0-Range2:1000~20000MHz

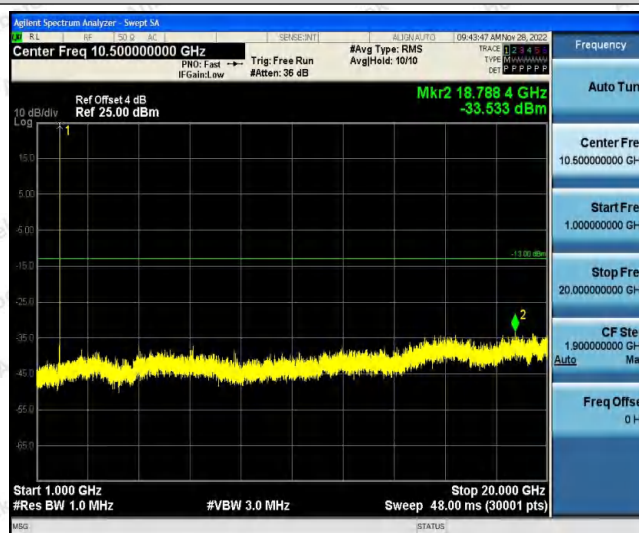

Band2-5MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

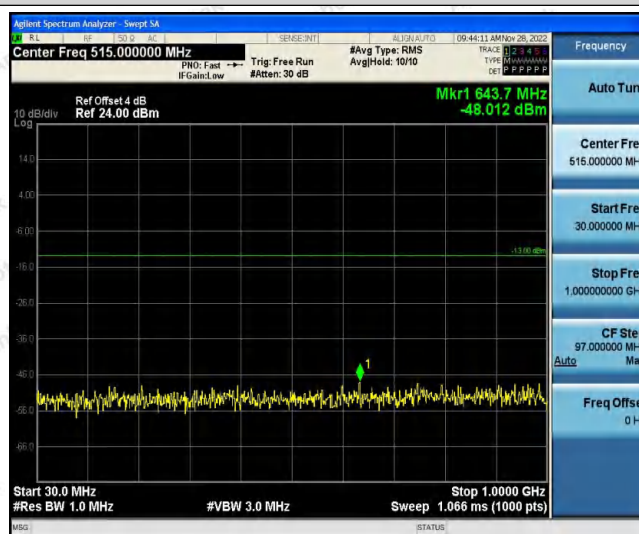

Band2-5MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

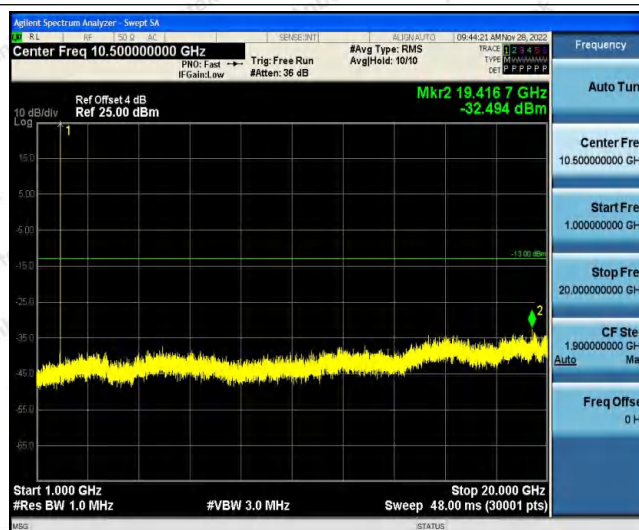

Band2-5MHz-16QAM-19175-1RB#0-Range1:30~1000MHz

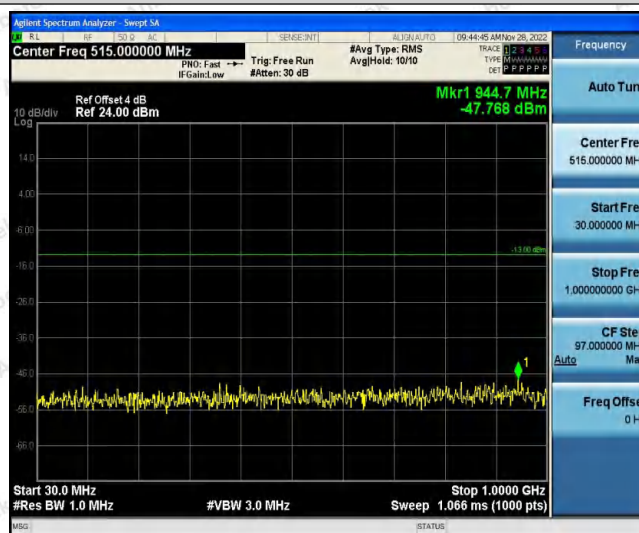

Band2-5MHz-16QAM-19175-1RB#0-Range2:1000~20000MHz

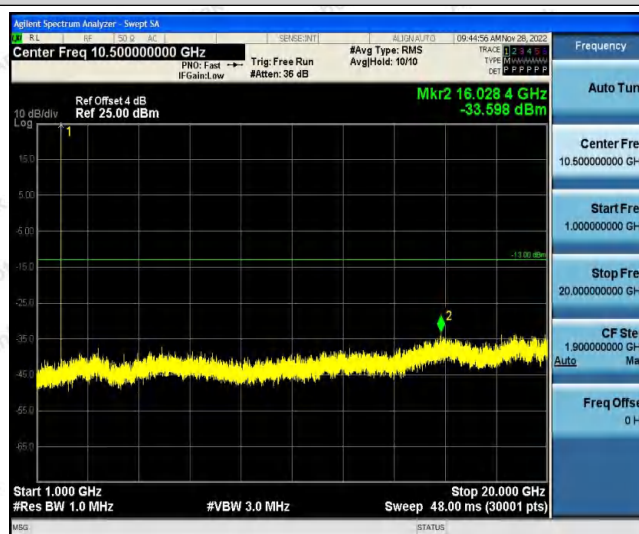

Band2-10MHz-QPSK-18650-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

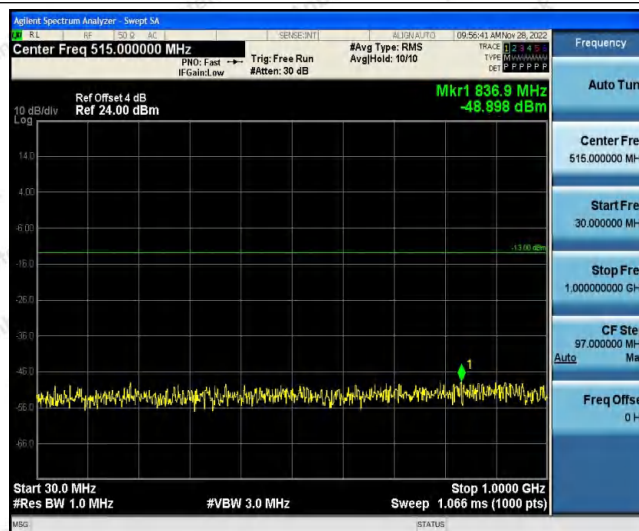

Band2-10MHz-QPSK-18650-1RB#0-Range2:1000~20000MHz

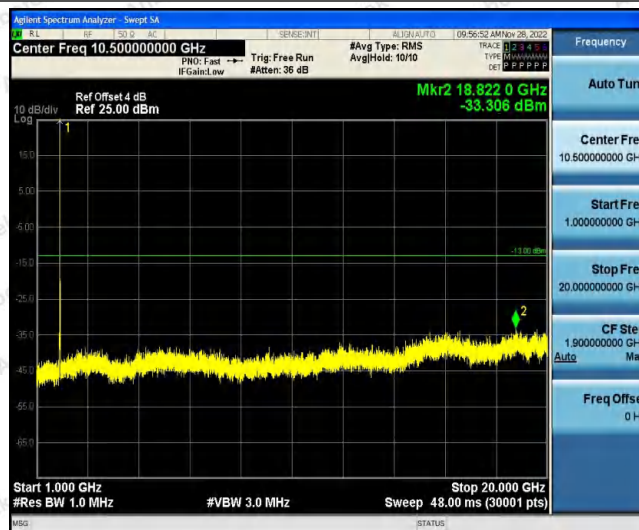

Band2-10MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

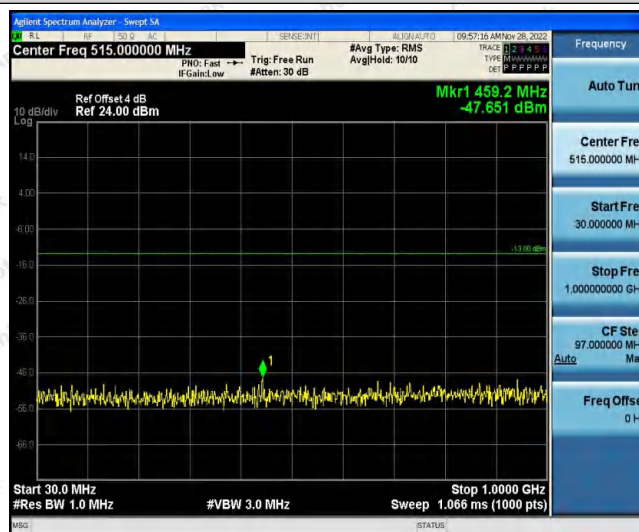

Band2-10MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

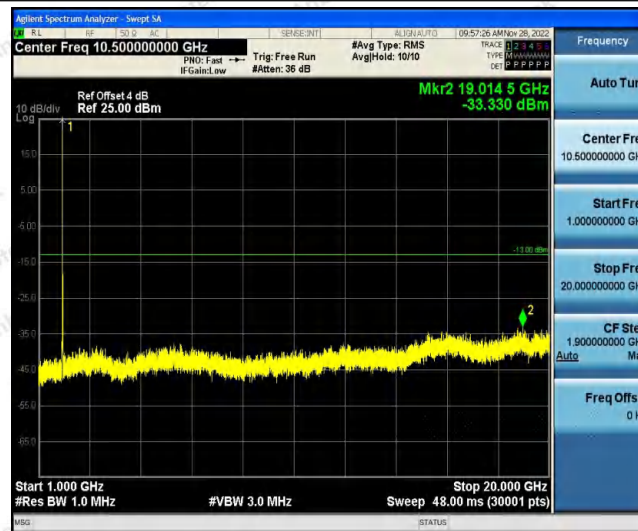

Band2-10MHz-QPSK-19150-1RB#0-Range1:30~1000MHz

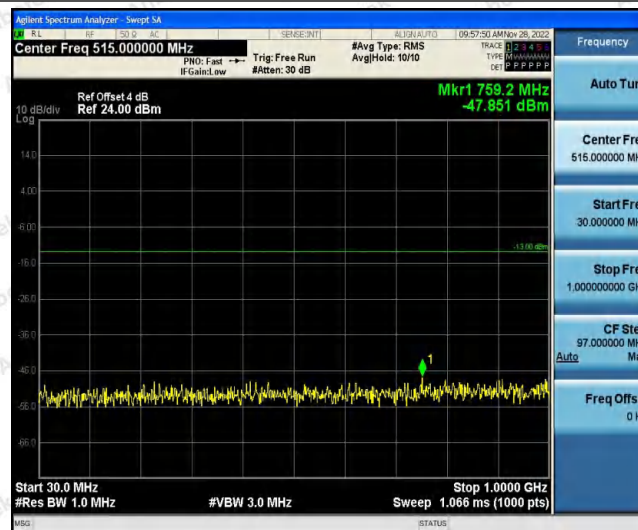

Band2-10MHz-QPSK-19150-1RB#0-Range2:1000~20000MHz

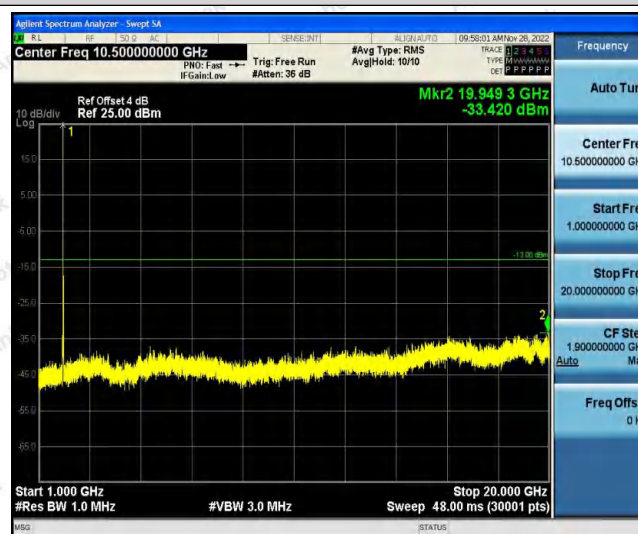


Band2-10MHz-16QAM-18650-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

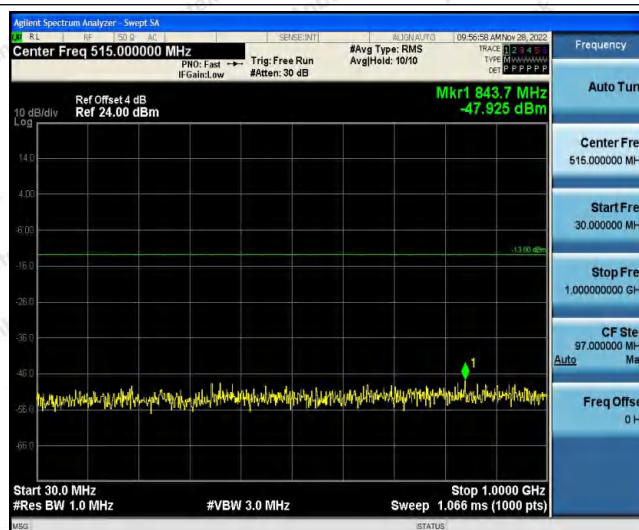

Band2-10MHz-16QAM-18650-1RB#0-Range2:1000~20000MHz

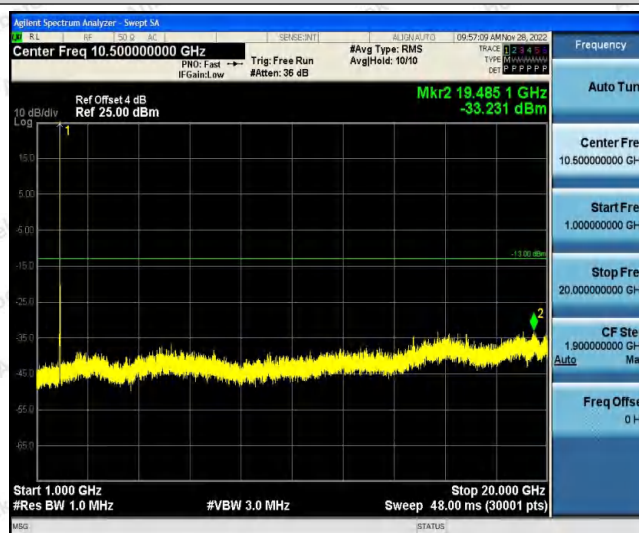

Band2-10MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

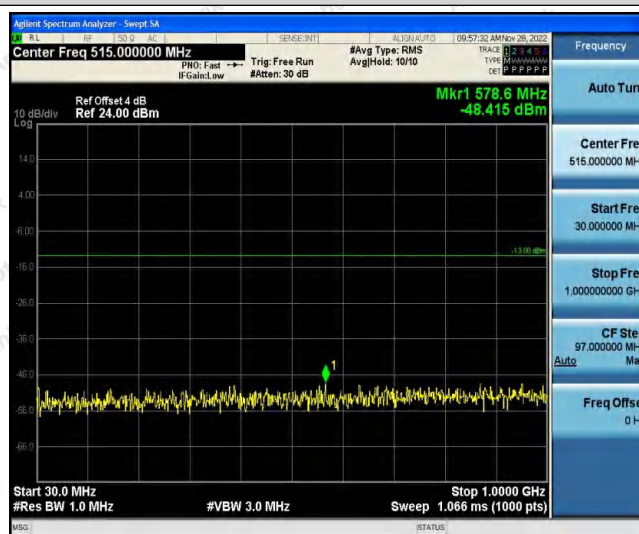

Band2-10MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com




Hotline

400-003-0500


www.anbotech.com

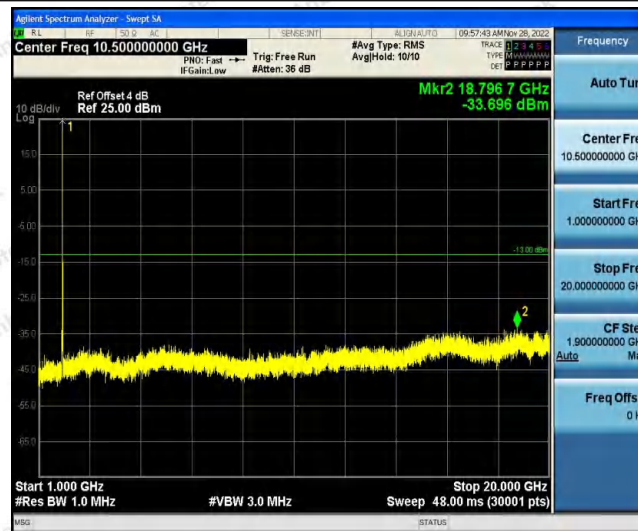

Band2-10MHz-16QAM-19150-1RB#0-Range1:30~1000MHz

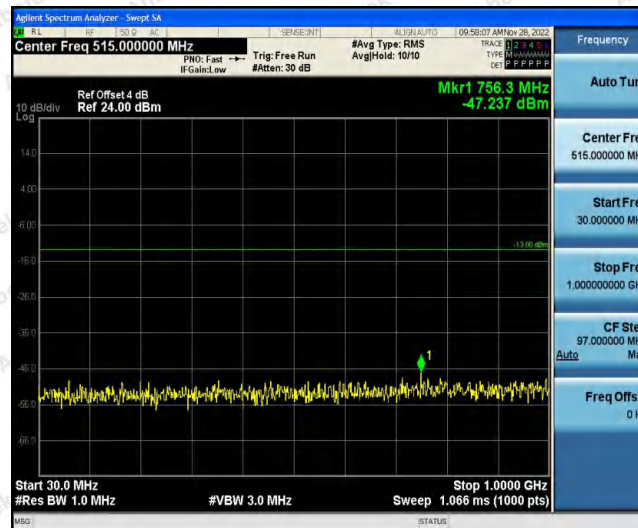

Band2-10MHz-16QAM-19150-1RB#0-Range2:1000~20000MHz

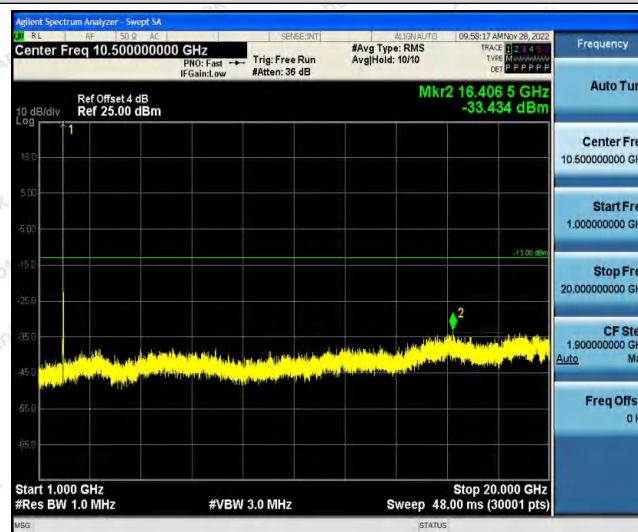


Band2-15MHz-QPSK-18675-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

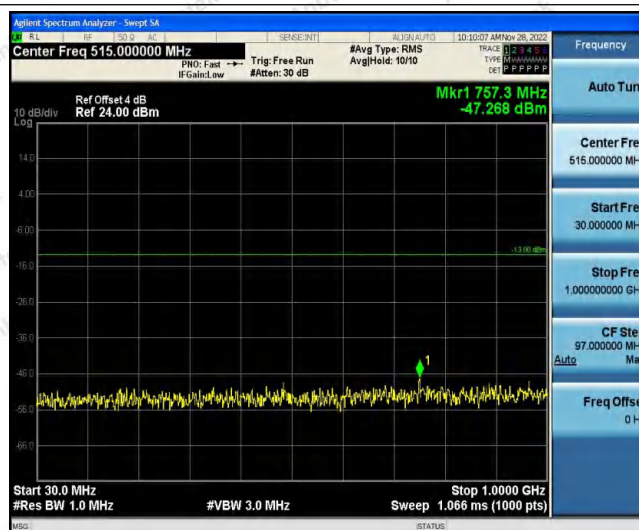

Band2-15MHz-QPSK-18675-1RB#0-Range2:1000~20000MHz

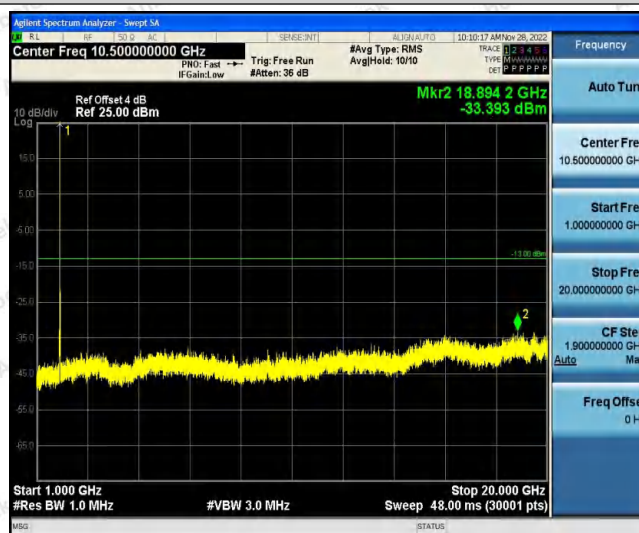

Band2-15MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

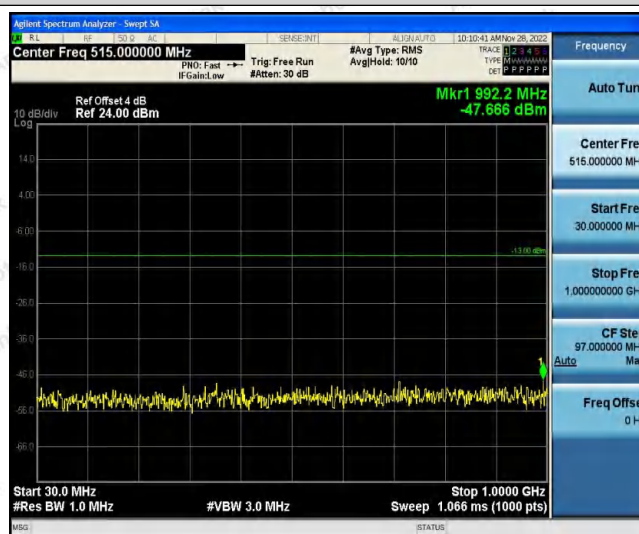

Band2-15MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

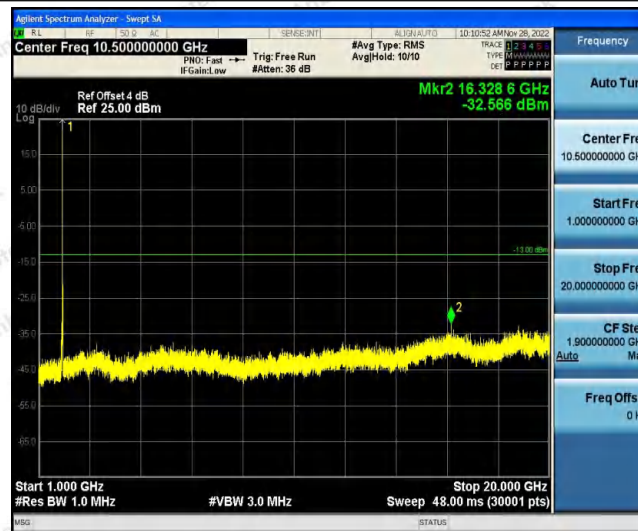

Band2-15MHz-QPSK-19125-1RB#0-Range1:30~1000MHz

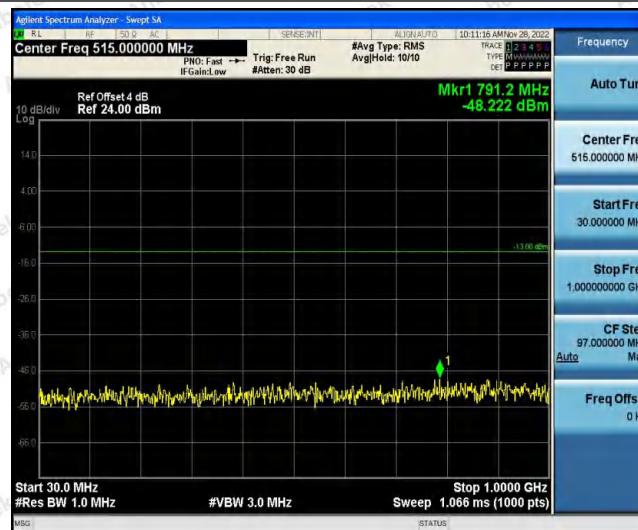

Band2-15MHz-QPSK-19125-1RB#0-Range2:1000~20000MHz

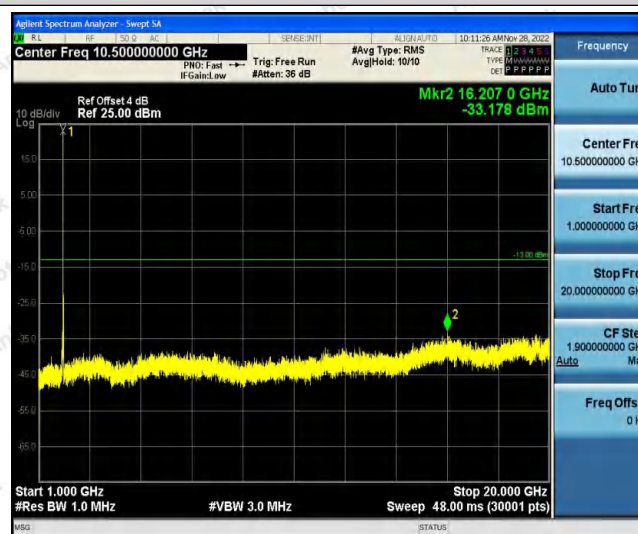

Band2-15MHz-16QAM-18675-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com

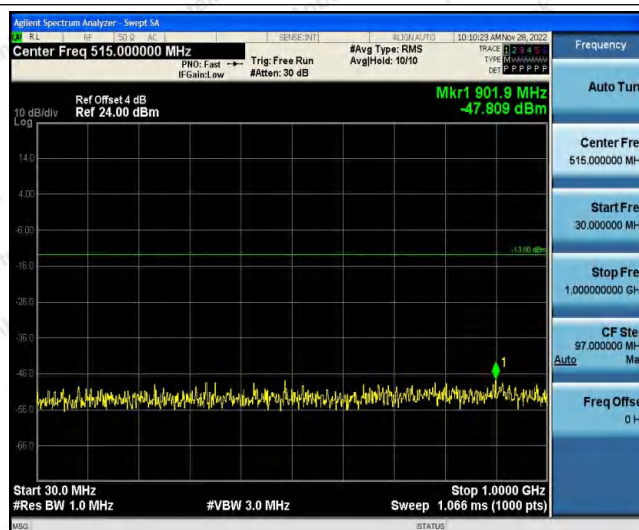

Band2-15MHz-16QAM-18675-1RB#0-Range2:1000~20000MHz

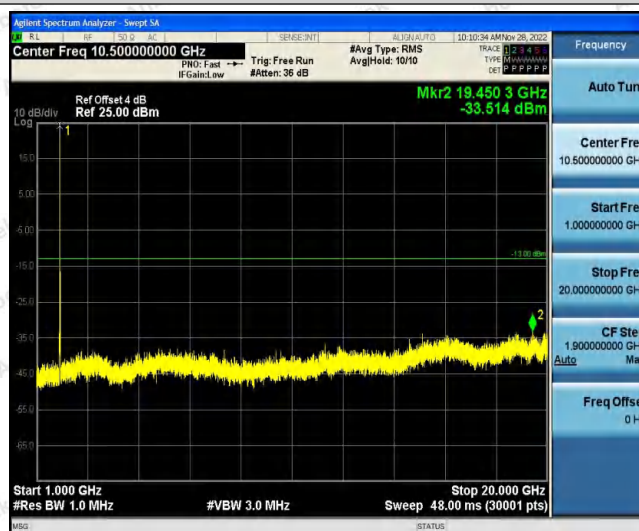

Band2-15MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

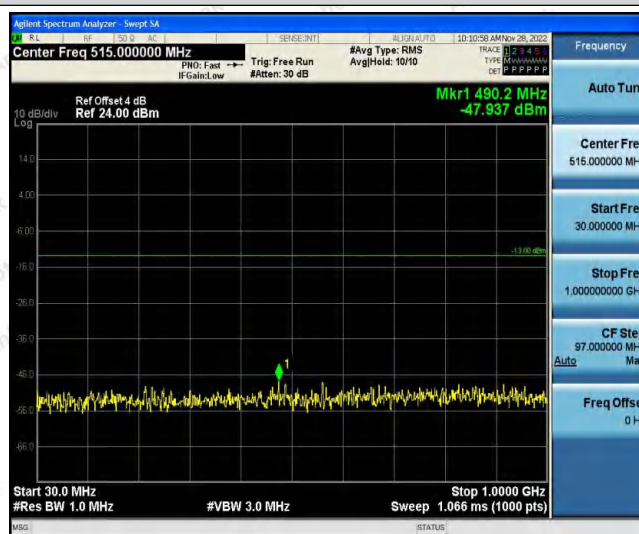

Band2-15MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

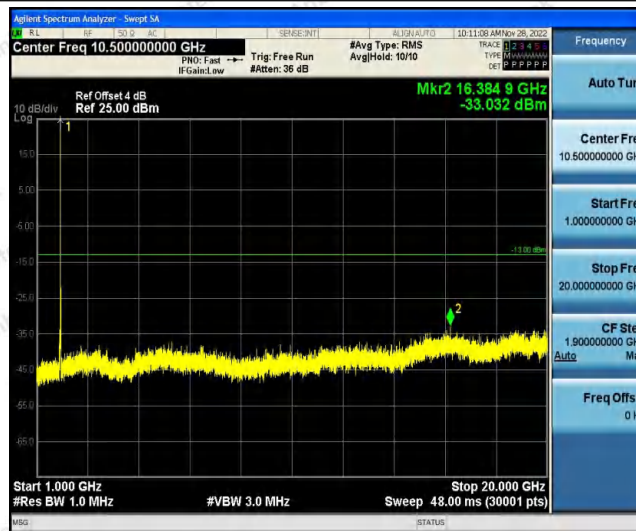

Band2-15MHz-16QAM-19125-1RB#0-Range1:30~1000MHz

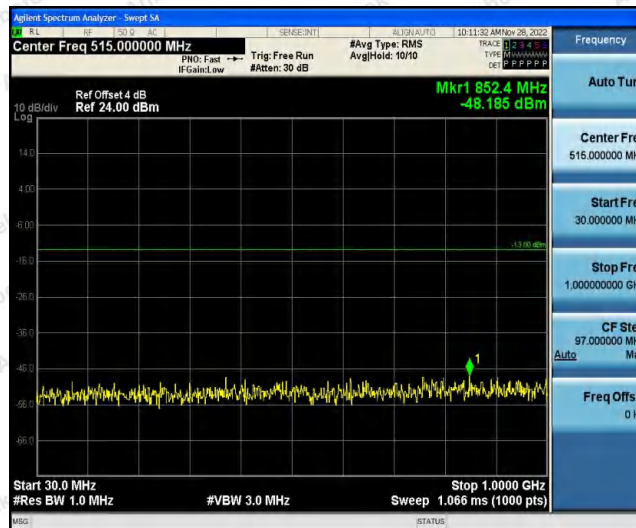

Band2-15MHz-16QAM-19125-1RB#0-Range2:1000~20000MHz

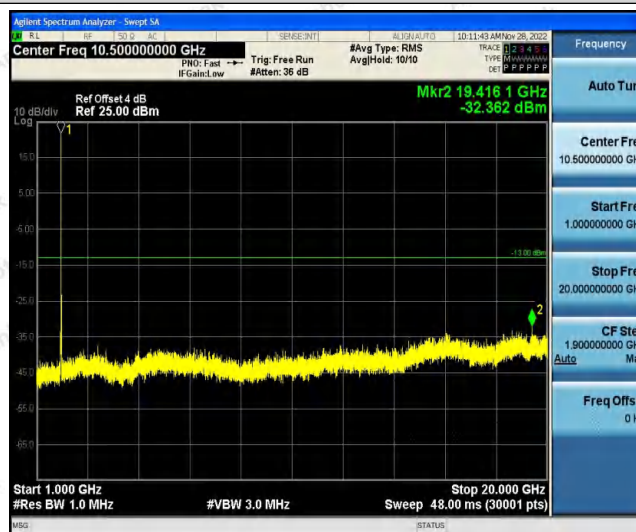

Band2-20MHz-QPSK-18700-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

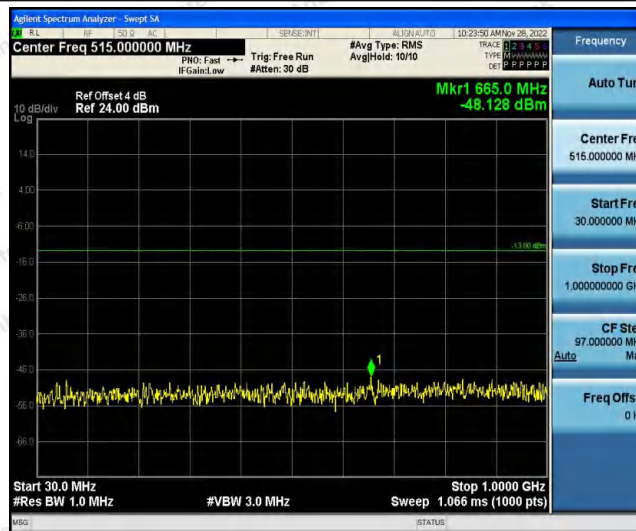

Band2-20MHz-QPSK-18700-1RB#0-Range2:1000~20000MHz

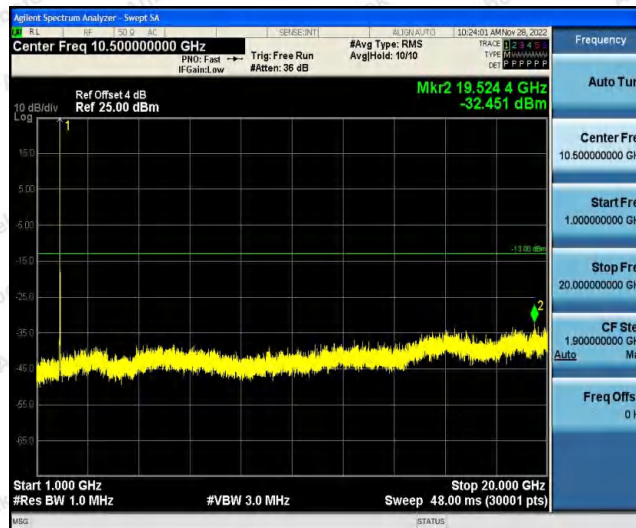

Band2-20MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

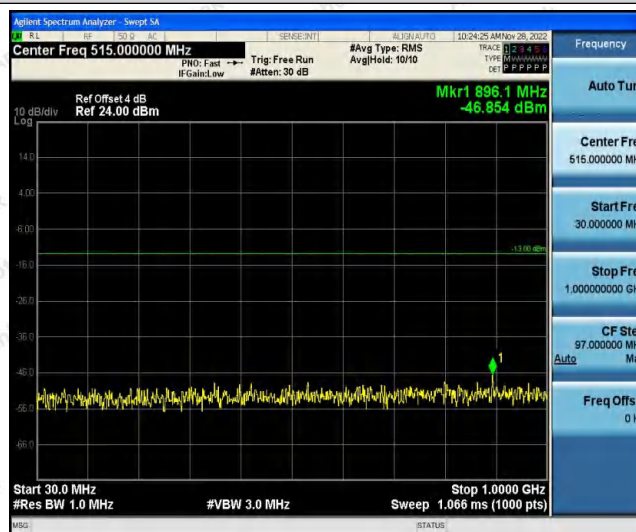

Band2-20MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

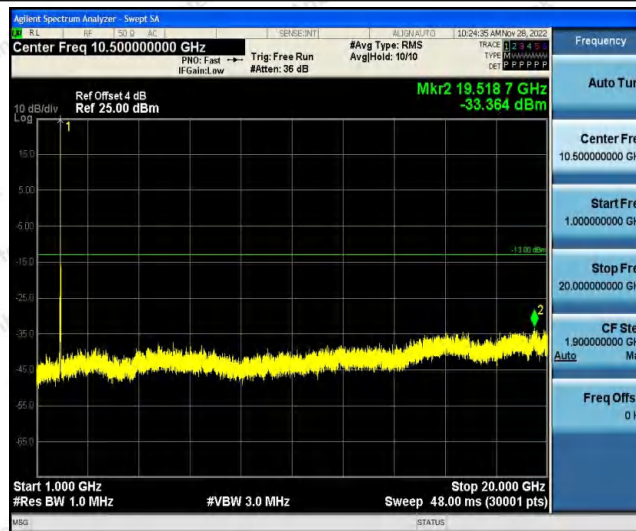

Band2-20MHz-QPSK-19100-1RB#0-Range1:30~1000MHz

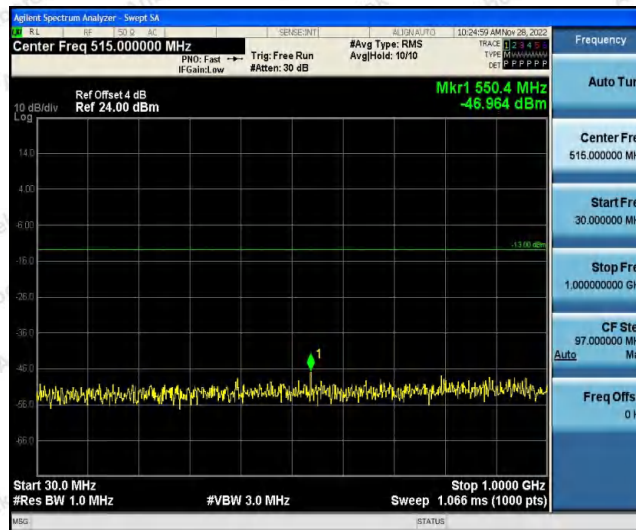

Band2-20MHz-QPSK-19100-1RB#0-Range2:1000~20000MHz

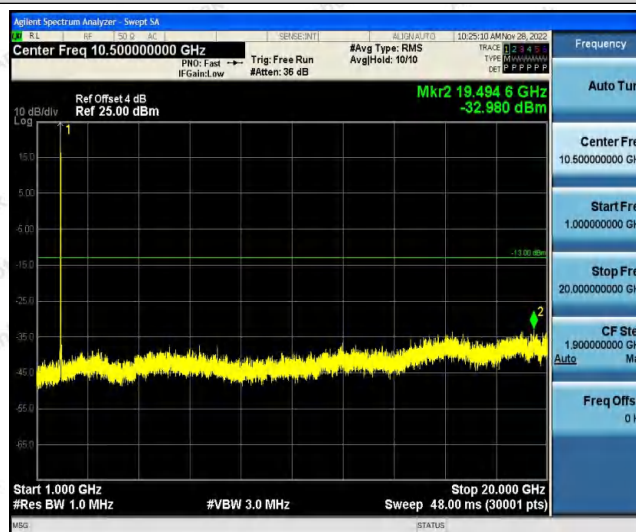

Band2-20MHz-16QAM-18700-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

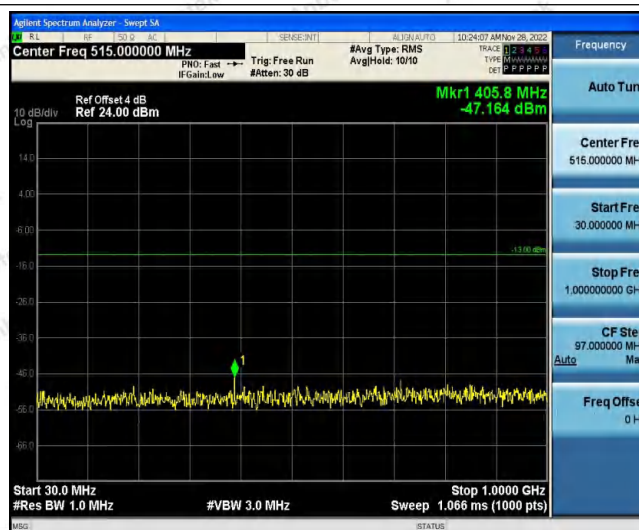

Band2-20MHz-16QAM-18700-1RB#0-Range2:1000~20000MHz

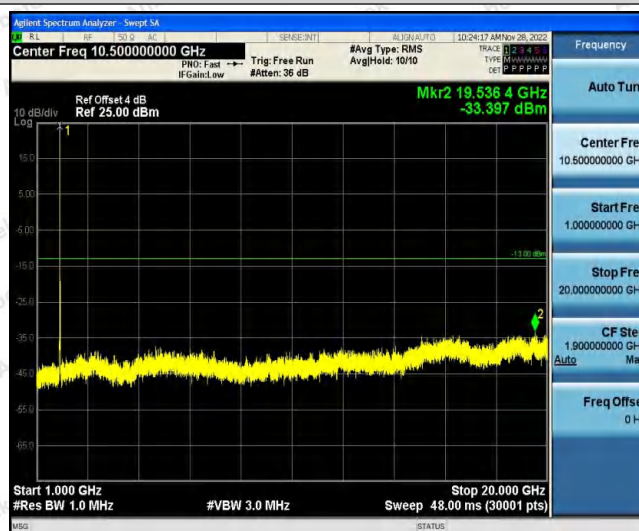

Band2-20MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

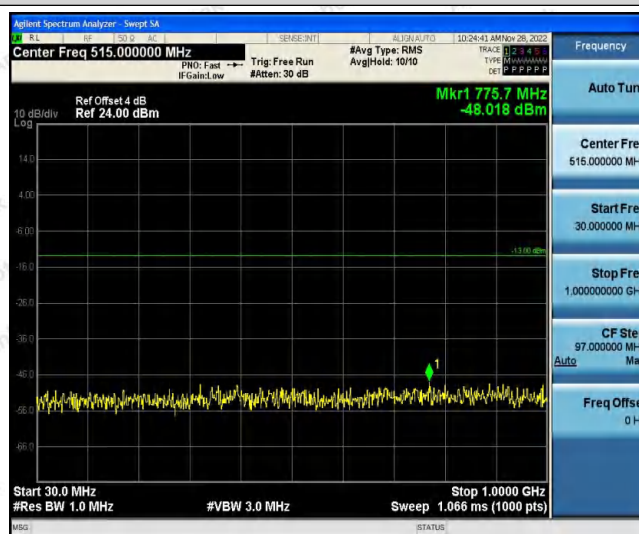

Band2-20MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

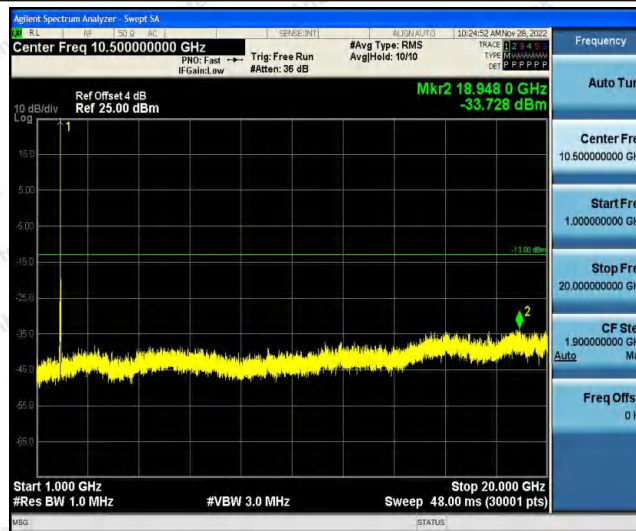

Band2-20MHz-16QAM-19100-1RB#0-Range1:30~1000MHz

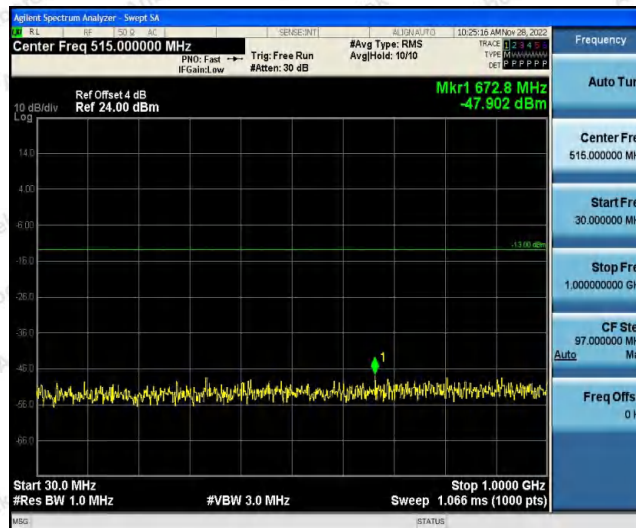

Band2-20MHz-16QAM-19100-1RB#0-Range2:1000~20000MHz

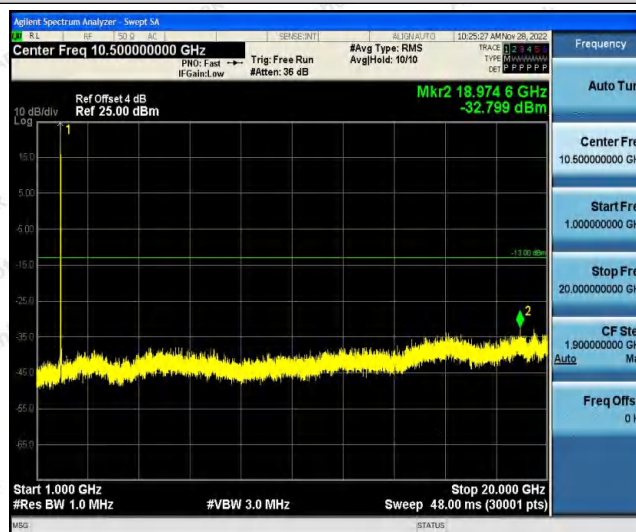

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Appendix F: Frequency stability VS Voltage measurement

Test Result

Band	Bandwidth	Modulation	Channel	RB Configure	Voltage		Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	-15.35	-0.008294	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	8.14	0.004398	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	-14.29	-0.007721	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	-19.33	-0.010282	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	-17.15	-0.009122	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	-10.34	-0.005500	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	-17.82	-0.009333	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	-12.06	-0.006316	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	-13.65	-0.007149	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	-8.85	-0.004782	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	-16.91	-0.009137	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	-13.88	-0.007500	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	10.93	0.005814	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	-13.29	-0.007069	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	-5.15	-0.002739	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	-3.56	-0.001865	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	3.75	0.001964	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	-6.97	-0.003651	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	-17.48	-0.009441	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VN	NT	5.05	0.002728	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	-17.65	-0.009533	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	-8.97	-0.004771	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	-8.90	-0.004734	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	-14.12	-0.007511	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	-22.99	-0.012046	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	15.32	0.008027	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	-20.38	-0.010679	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	-13.29	-0.007178	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	-14.66	-0.007918	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	-25.13	-0.013573	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	-12.53	-0.006665	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	-16.59	-0.008824	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	2.98	0.001585	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VL	NT	-16.98	-0.008897	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

Band2	3MHz	16QAM	19185	15RB#0	VN	NT	-16.41	-0.008598	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VH	NT	1.69	0.000886	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	-10.76	-0.005808	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	-13.59	-0.007336	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	-13.55	-0.007314	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	-18.24	-0.009702	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	-13.79	-0.007335	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	-21.41	-0.011388	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	-13.95	-0.007313	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	-16.84	-0.008828	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	4.21	0.002207	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	-13.07	-0.007055	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VN	NT	-2.12	-0.001144	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	-13.80	-0.007449	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	-18.14	-0.009649	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	-18.54	-0.009862	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	-15.74	-0.008372	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	5.25	0.002752	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	-13.70	-0.007182	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	-13.95	-0.007313	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	-10.83	-0.005838	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	-16.91	-0.009116	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	9.23	0.004976	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	-11.84	-0.006298	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VN	NT	-17.24	-0.009170	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	-11.04	-0.005872	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	-16.05	-0.008425	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	11.40	0.005984	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	-16.12	-0.008462	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VL	NT	-9.23	-0.004976	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VN	NT	-16.59	-0.008943	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VH	NT	-15.36	-0.008280	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VL	NT	5.29	0.002814	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VN	NT	-20.06	-0.010670	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VH	NT	-11.82	-0.006287	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VL	NT	-10.67	-0.005601	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VN	NT	-18.22	-0.009564	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VH	NT	-11.14	-0.005848	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	9.23	0.004969	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	-14.75	-0.007941	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VH	NT	-14.49	-0.007801	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

Band2	15MHz	QPSK	18900	75RB#0	VL	NT	-18.25	-0.009707	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	-11.04	-0.005872	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	-10.06	-0.005351	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	-16.08	-0.008452	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	-13.90	-0.007306	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	-12.35	-0.006491	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VL	NT	-14.55	-0.007833	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VN	NT	10.54	0.005674	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VH	NT	-9.14	-0.004921	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VL	NT	-18.97	-0.010090	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VN	NT	-13.07	-0.006952	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VH	NT	-18.47	-0.009824	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VL	NT	-17.07	-0.008972	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VN	NT	-14.42	-0.007580	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VH	NT	-15.13	-0.007953	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VL	NT	-14.08	-0.007570	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VN	NT	-19.20	-0.010323	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VH	NT	-13.66	-0.007344	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VL	NT	-21.59	-0.011484	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	-11.73	-0.006239	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VH	NT	-16.58	-0.008819	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VL	NT	-12.47	-0.006563	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VN	NT	-6.39	-0.003363	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VH	NT	11.44	0.006021	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VL	NT	-12.55	-0.006747	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VN	NT	-14.02	-0.007538	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VH	NT	-16.75	-0.009005	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VL	NT	-7.78	-0.004138	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VN	NT	-12.35	-0.006569	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VH	NT	-14.81	-0.007878	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VL	NT	-16.75	-0.008816	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VN	NT	-17.42	-0.009168	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VH	NT	-14.35	-0.007553	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
www.anbotek.com

Appendix G: Frequency stability VS Temperature measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-30	-16.95	-0.009159	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-20	-15.49	-0.008370	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	0	-3.40	-0.001837	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	10	3.39	0.001832	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	20	3.15	0.001702	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	-11.27	-0.005995	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	10.96	0.005830	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	-16.81	-0.008941	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	-17.47	-0.009293	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	-16.42	-0.008734	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-30	-9.87	-0.005169	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-20	-14.13	-0.007401	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	0	-12.46	-0.006526	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	10	-12.92	-0.006767	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	20	4.16	0.002179	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-30	-12.85	-0.006943	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-20	-11.13	-0.006014	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	0	-14.23	-0.007689	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	10	-20.20	-0.010915	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	20	-14.99	-0.008100	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-30	4.75	0.002527	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-20	-4.95	-0.002633	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	0	-15.54	-0.008266	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	10	-10.06	-0.005351	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	20	-8.04	-0.004277	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-30	-14.85	-0.007778	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-20	-9.20	-0.004819	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	0	-17.52	-0.009176	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	10	7.28	0.003813	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	20	-18.77	-0.009831	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-30	-14.91	-0.008053	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-20	-3.38	-0.001826	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	0	-16.08	-0.008685	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	10	-15.91	-0.008593	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	20	-19.40	-0.010478	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band2	3MHz	QPSK	18900	15RB#0	NV	-30	-11.29	-0.006005	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-20	-16.16	-0.008596	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	-14.09	-0.007495	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	10	4.02	0.002138	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	4.78	0.002543	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-30	-4.75	-0.002489	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-20	-21.39	-0.011208	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	0	-3.79	-0.001986	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	10	3.02	0.001582	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	20	-19.20	-0.010060	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-30	-20.00	-0.010802	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-20	-16.59	-0.008960	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	0	-3.76	-0.002031	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	10	-20.47	-0.011056	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	20	-13.40	-0.007237	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-30	-16.48	-0.008766	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-20	-18.53	-0.009856	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	0	-18.63	-0.009910	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	10	4.29	0.002282	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	20	-17.22	-0.009160	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-30	-15.08	-0.007901	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-20	-18.42	-0.009652	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	0	-4.33	-0.002269	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	10	-18.31	-0.009594	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	20	-2.32	-0.001216	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-30	7.72	0.004167	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-20	7.47	0.004032	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	0	-14.28	-0.007709	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	10	-19.91	-0.010748	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	20	-11.87	-0.006408	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	-14.99	-0.007973	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	3.99	0.002122	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	0	-7.94	-0.004223	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	-18.22	-0.009691	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	-15.85	-0.008431	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-30	-12.67	-0.006642	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-20	8.77	0.004598	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	0	-9.97	-0.005227	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	10	-3.88	-0.002034	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	20	-12.73	-0.006674	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-30	-16.72	-0.009026	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

Band2	5MHz	16QAM	18625	25RB#0	NV	-20	-15.92	-0.008594	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	0	-13.59	-0.007336	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	10	-16.38	-0.008842	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	20	-12.79	-0.006904	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-30	-19.07	-0.010144	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-20	-2.55	-0.001356	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	0	-5.61	-0.002984	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	10	-1.96	-0.001043	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	20	-4.02	-0.002138	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-30	6.18	0.003240	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-20	-13.16	-0.006899	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	0	4.09	0.002144	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	10	7.27	0.003811	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	20	-17.37	-0.009106	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-30	-13.55	-0.007305	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-20	-13.73	-0.007402	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	0	5.61	0.003024	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	10	-13.28	-0.007159	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	20	-13.29	-0.007164	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	-17.51	-0.009314	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-20	-11.14	-0.005926	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	-12.03	-0.006399	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	-15.21	-0.008090	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	-10.29	-0.005473	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-30	-12.36	-0.006488	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-20	8.20	0.004304	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	0	-13.40	-0.007034	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	10	-13.76	-0.007223	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	20	-12.66	-0.006646	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-30	-13.66	-0.007364	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-20	11.12	0.005995	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	0	-16.37	-0.008825	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	10	-15.15	-0.008167	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	20	6.35	0.003423	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-30	-11.73	-0.006239	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-20	-10.76	-0.005723	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	0	-15.09	-0.008027	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	10	5.04	0.002681	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	20	8.97	0.004771	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-30	-21.16	-0.011108	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-20	-5.85	-0.003071	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

Band2	10MHz	16QAM	19150	50RB#0	NV	0	-8.10	-0.004252	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	10	-16.68	-0.008756	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	20	-16.91	-0.008877	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-30	6.32	0.003402	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-20	-10.79	-0.005809	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	0	-15.79	-0.008501	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	10	-4.52	-0.002433	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	20	-7.58	-0.004081	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-30	-15.52	-0.008255	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-20	-12.67	-0.006739	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	0	-14.29	-0.007601	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	10	-18.85	-0.010027	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	20	-14.23	-0.007569	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-30	-12.45	-0.006544	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-20	-10.11	-0.005314	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	0	-15.49	-0.008142	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	10	-14.58	-0.007664	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	20	-16.14	-0.008484	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-30	-8.78	-0.004727	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-20	-10.56	-0.005685	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	0	-12.46	-0.006708	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	10	-11.49	-0.006186	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	20	-8.05	-0.004334	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-30	-18.67	-0.009931	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-20	-4.35	-0.002314	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	0	-15.71	-0.008356	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	10	-16.01	-0.008516	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	20	-10.44	-0.005553	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-30	-16.58	-0.008715	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-20	-19.04	-0.010008	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	0	-18.55	-0.009750	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	10	-19.38	-0.010187	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	20	-9.24	-0.004857	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-30	-16.42	-0.008828	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-20	-7.93	-0.004263	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	0	-14.85	-0.007984	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	10	-15.34	-0.008247	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	20	-15.23	-0.008188	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-30	-16.75	-0.008910	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-20	-14.75	-0.007846	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	0	-20.27	-0.010782	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

Band2	20MHz	QPSK	18900	100RB#0	NV	10	-12.80	-0.006809	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	20	-17.09	-0.009090	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-30	-8.77	-0.004616	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-20	-9.24	-0.004863	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	0	-14.36	-0.007558	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	10	-12.92	-0.006800	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	20	-13.58	-0.007147	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-30	-17.19	-0.009242	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-20	-17.90	-0.009624	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	0	-21.60	-0.011613	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	10	-13.60	-0.007312	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	20	-20.21	-0.010866	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-30	-14.78	-0.007862	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-20	-12.89	-0.006856	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	0	-17.81	-0.009473	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	10	-13.15	-0.006995	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	20	9.41	0.005005	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-30	-14.95	-0.007868	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-20	-16.87	-0.008879	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	0	-11.86	-0.006242	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	10	-9.17	-0.004826	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	20	-10.81	-0.005689	±2.5	PASS

---End---