



36 MOSFET Controller

HK-YCK060300A(RSVR)

PRODUCT SPECIFICATION

HUAKONG INTELLIGENT Controller Specification

Document	Controller Specification	Model number	HK-YCK060V300A(RSVR)	Ver	00
Department	RD	Date	2023.5.4	Page	1

一、 Scope


Suitable for 36 mosfet controller.

二、 Reference Standards

- 2.1 QC/T 792—2007 Electric motorcycle and electric moped Motor and Controller technical conditions
- 2.2 QB/T 2946—2008 Electric vehicle Motor and Controller

三、 Controller Naming Standard

This naming rule refer to: GB_T+18488.1-2015 drive motor system for electric vehicles

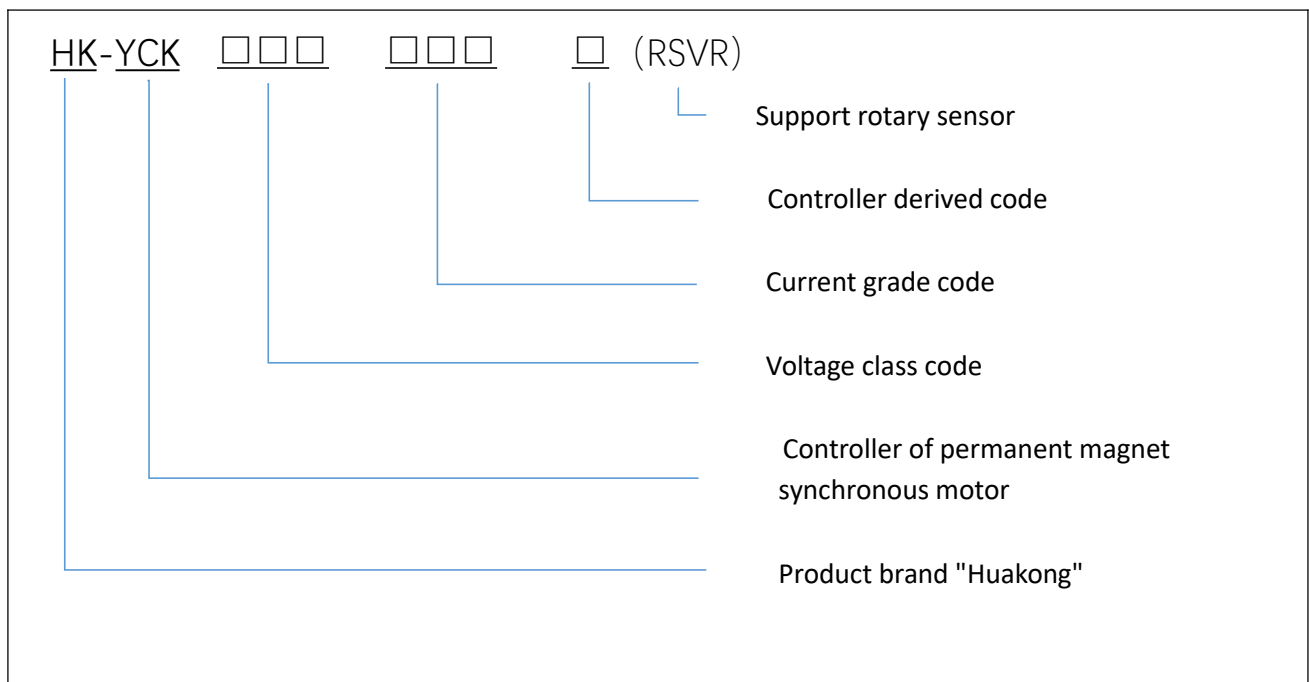

HUAKONG INTELLIGENT Controller Specification

Document	Controller Specification	Model number	HK-YCK060V300A(RSVR)	Ver	00
Department	RD	Date	2023.5.4	Page	2


四、 Controller Specification**4.1 Basic Specification**

#	ITEM	DETAILS
1	Working Voltage	24~96V
2	Rated Voltage	60V
3	Maximum Current	300A
4	Low-voltage protection	Regulable
5	Overvoltage protection	Regulable
6	Maximum efficiency	≥97%
7	Ingress Protection Rating	H
8	Working Temperature	-25℃-105℃
9	Ingress Protection Rating	IP67
10	Feedback Sensor	Rotary encoder
11	Cooling Method	Natural Cooling
12	Temperature Sensor	KTY84-150
13	Cable Length	/
14	Function Cable Length	/
15	Dimension	215L*138W*67H
16	Weight	1.95kg

Document	Controller Specification	Model number	HK-YCK060V300A(RSVR)	Ver	00
Department	RD	Date	2023.5.4	Page	3

4.2 Dimensions and appearance

4.2.1 Please see drawing for all of dimensions.

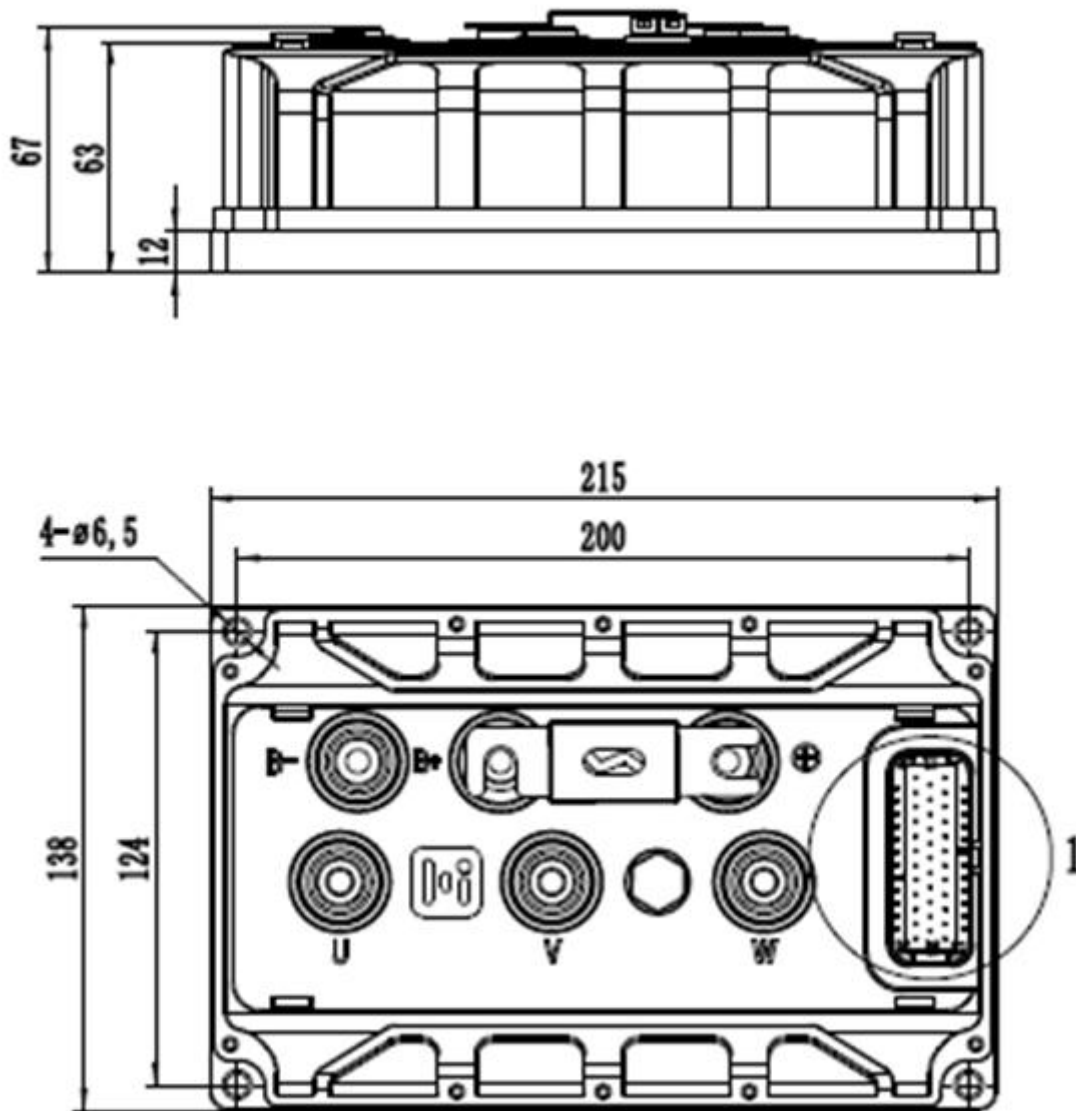

4.2.2 Appearance

The surface is clean, there are no obvious scratches and mechanical damage, no deformation, no other appearance defects.

Document	Controller Specification	Model number	HK-YCK060V300A(RSVR)	Ver	00
Department	RD	Date	2023.5.4	Page	4

五、 The controller detects the fault code table

The controller detects the fault code table		
NO	type of alarm	fault type
1	 	Operation sequence error
2	  	Accelerator fault
3	   	System overvoltage
4	  	The system voltage is too low. Procedure
5	  	Current sensor fault
6	   	The motor is missing a phase
7	    	Excessive motor temperature
8	   	Controller temperature is too high.
9	    	The capacitor precharge fails
10	    	Motor blocking protection
11	     	Controller overcurrent protection
12	      	Relay fault

Document	Controller Specification	Model number	HK-YCK060V300A(RSVR)	Ver	00
Department	RD	Date	2023.5.4	Page	5


六、 Function and performance

6.1 Please see drawing for function definition details.



Controller wiring diagram

Controller connector 35Pin
 Model number 776231-1

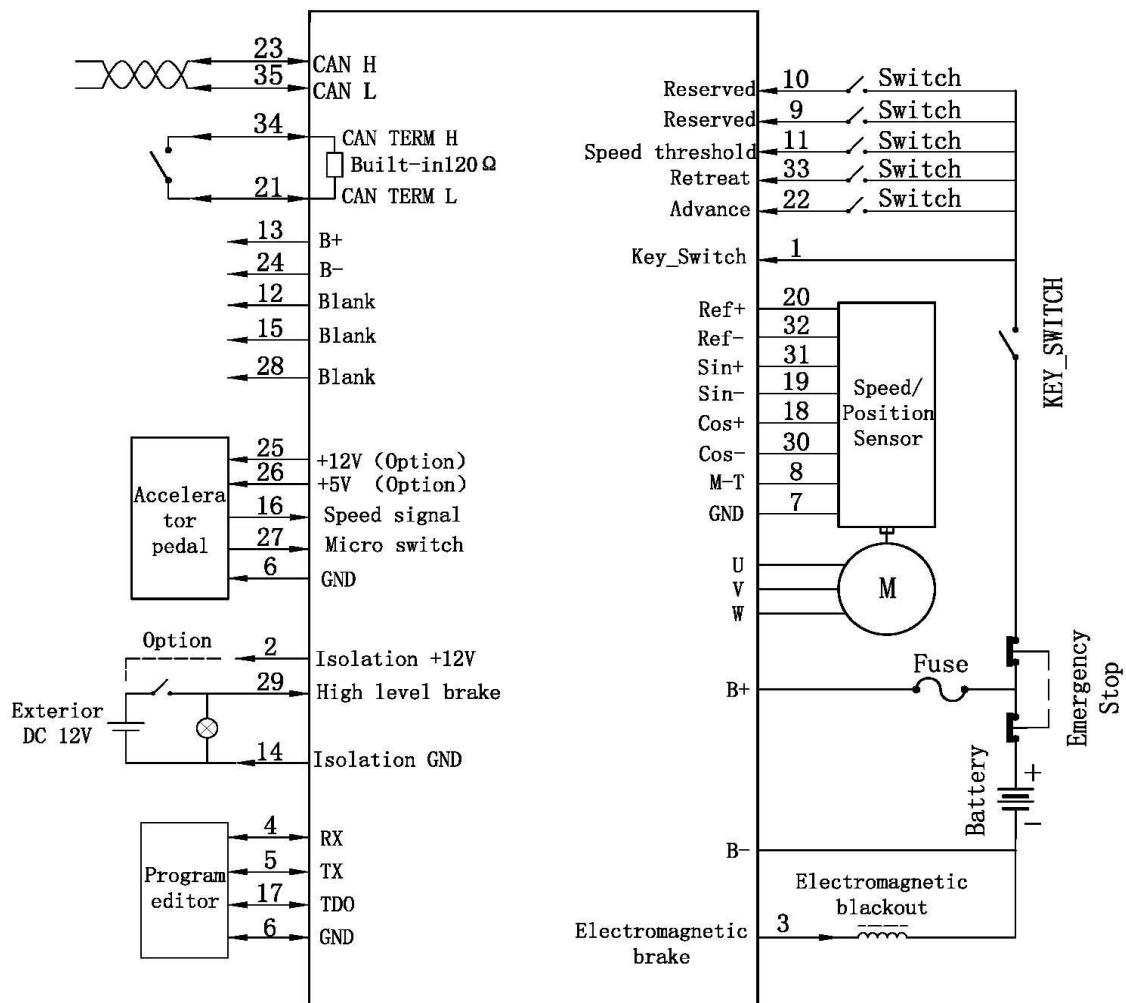

Document	Controller Specification	Model number	HK-YCK060V300A(RSVR)	Ver	00
Department	RD	Date	2023.5.4	Page	6

6.2 Performance test requirement

#	Item	Verification Conditions	Notes
1	High temperature test	The controller should still be able to work normally after 2 hours continuous no-load operation when the ambient temperature is in the range of $60^{\circ}\text{C} \pm 2^{\circ}\text{C}$.	
2	Constant heat and humidity test	The controller shall be capable for 48 hours testing of withstanding a constant moist heat $40^{\circ}\text{C} \pm 2^{\circ}\text{C}$ and relative humidity of 90% ~ 95% which shall not affect normal operation after the test.	
3	Low temperature start test	The controller can still start without load when the ambient temperature is in the range of $-25^{\circ}\text{C} \pm 1^{\circ}\text{C}$ and the cold state lasts for 2 hours.	
4	Load vibration test	The controller is fixed on the test bench and the vibration test is performed according to the specified conditions. No parts loosening or damage may occur during the test.	
5	Low temperature storage test	Stored at -25°C for 72 hours, it should still work after returning to normal temperature.	
6	Short-term overload test	The motor shall be inspected in accordance with the QC/T792-2007 short-term overload test condition and the conformity assessment method.	

HUAKONG INTELLIGENT Controller Specification

Document	Controller Specification	Model number	HK-YCK060V300A(RSVR)	Ver	00
Department	RD	Date	2023.5.4	Page	7

#	Item	Verification Conditions	Notes
7	Impact test	The controller should still work normally after do the impact test 7 times with the matched controller and the load is 100 Kg when the battery is fully charged.	
8	Waterproof test	The controller shall be inspected in accordance with the GB/T4942.1-2001 IP67 grade product specified anti-drip test conditions (the controller is in a non-energized state during the test) and the conformity assessment method.	
9	Wire flame test	After two 10-seconds burning tests on the sample, the flame extinguished within 60 seconds and no burning material could be dropped.	

七、 Precautions

- 7.1 Connect the wires of the controller correctly, and install the controller in a ventilated and waterproof place and prevent loosening.
- 7.2 All plug terminals must ensure good contact and must not be loose. Otherwise, unpredictable faults and consequences will occur.
- 7.3 Must ensure that the voltage in the controller within the reasonable usage voltage range, in order to ensure the reliability of the controller.
- 7.4 It must be ensured that the controller power matches the motor power correctly.
- 7.5 It is forbidden to change the controller external structure or violent impact the controller.
- 7.6 Pay attention to the bushing of the motor phase wire or the speed wire to wrap well so as not to short-circuit with the power ground wire or other signal wire, resulting in controller damage.

Document	Controller Specification	Model number	HK-YCK060V300A(RSVR)	Ver	00
Department	RD	Date	2023.5.4	Page	8

Warning: Changes or modifications to this unit not expressly approved by the party responsible for compliance could void the user's authority to operate the equipment.

NOTE: This equipment has been tested and found to comply with the limits for a Class B digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference in a residential installation. This equipment generates, uses and can radiate radio frequency energy and, if not installed and used in accordance with the instructions, may cause harmful interference to radio communications.

However, there is no guarantee that interference will not occur in a particular installation. If this equipment does cause harmful interference to radio or television reception, which can be determined by turning the equipment off and on, the user is encouraged to try to correct the interference by one or more of the following measures:

- Reorient or relocate the receiving antenna.
- Increase the separation between the equipment and receiver.
- Connect the equipment into an outlet on a circuit different from that to which the receiver is connected.
- Consult the dealer or an experienced radio/TV technician for help

The device must not be co-located or operating in conjunction with any other antenna or transmitter.

This device complies with Part 15 of the FCC Rules. Operation is subject to the following two conditions : (1) this device may not cause harmful interference, and (2) this device must accept any interference received, including interference that may cause undesired operation.

FCC RF Radiation Exposure Statement Caution: To maintain compliance with the FCC's RF exposure guidelines, place the product at least 20cm from nearby persons.