







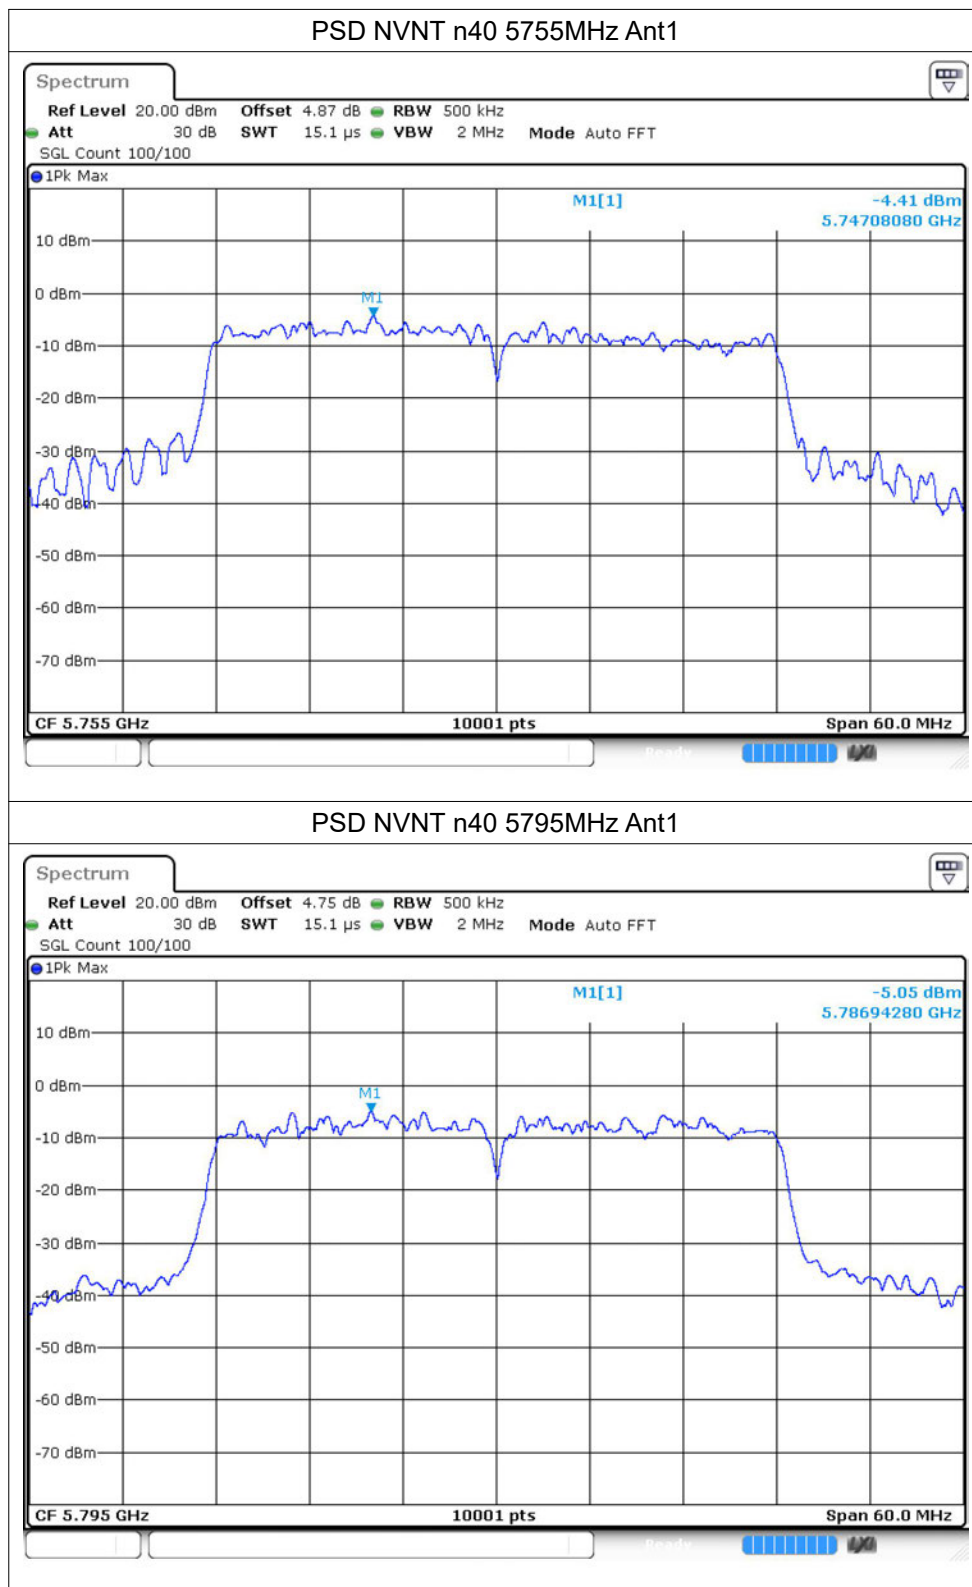

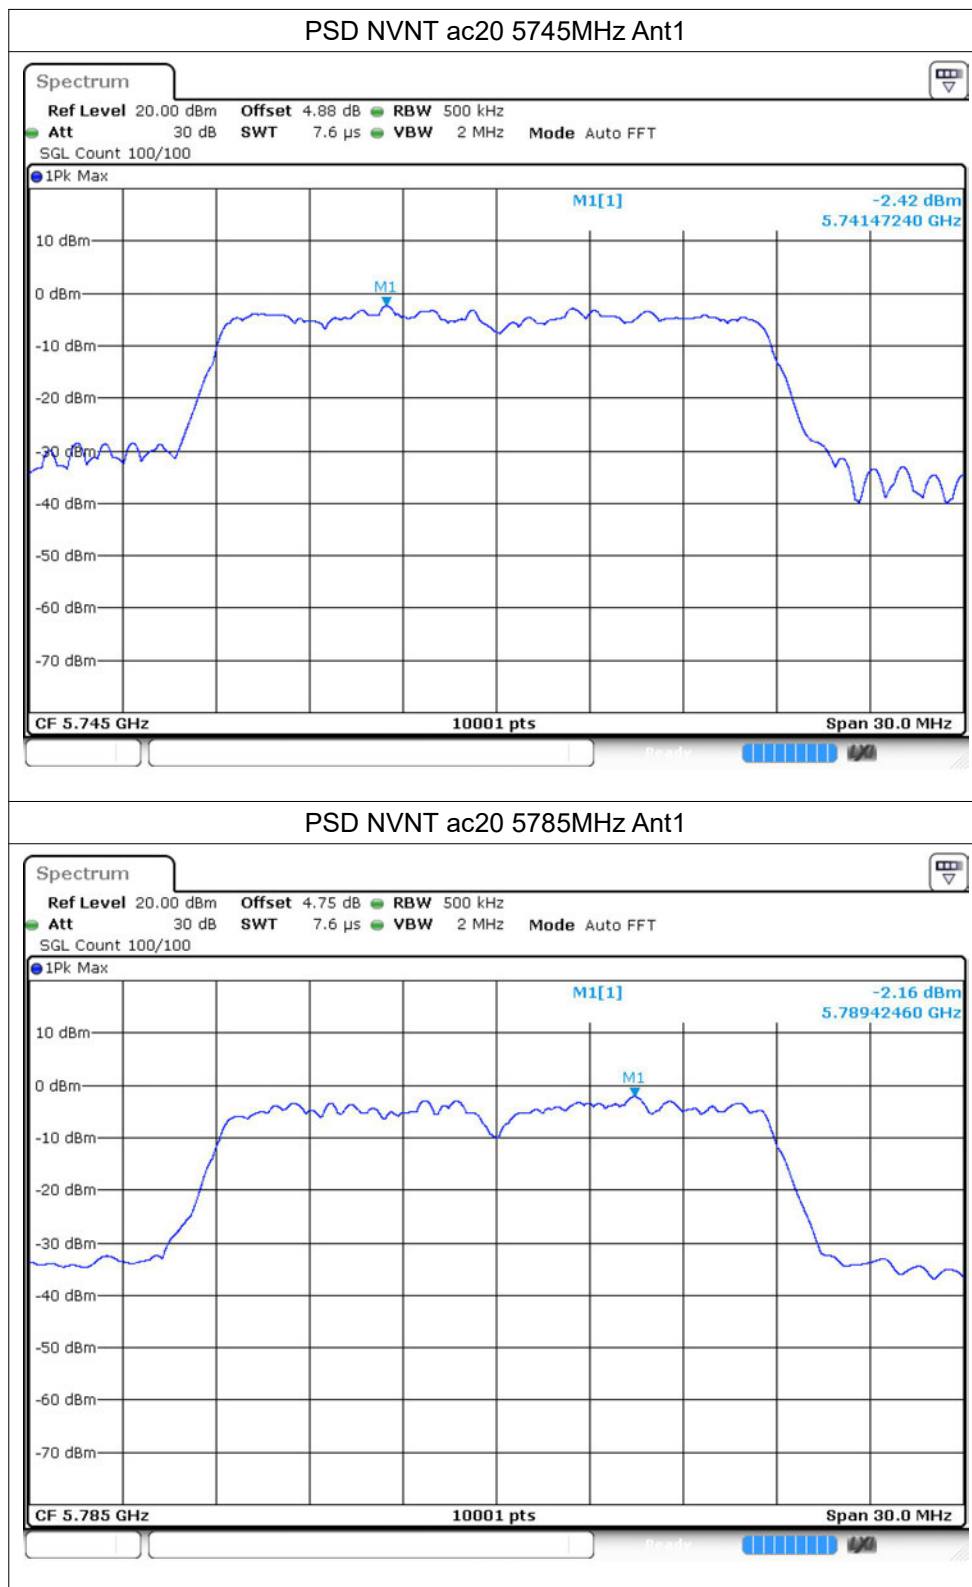


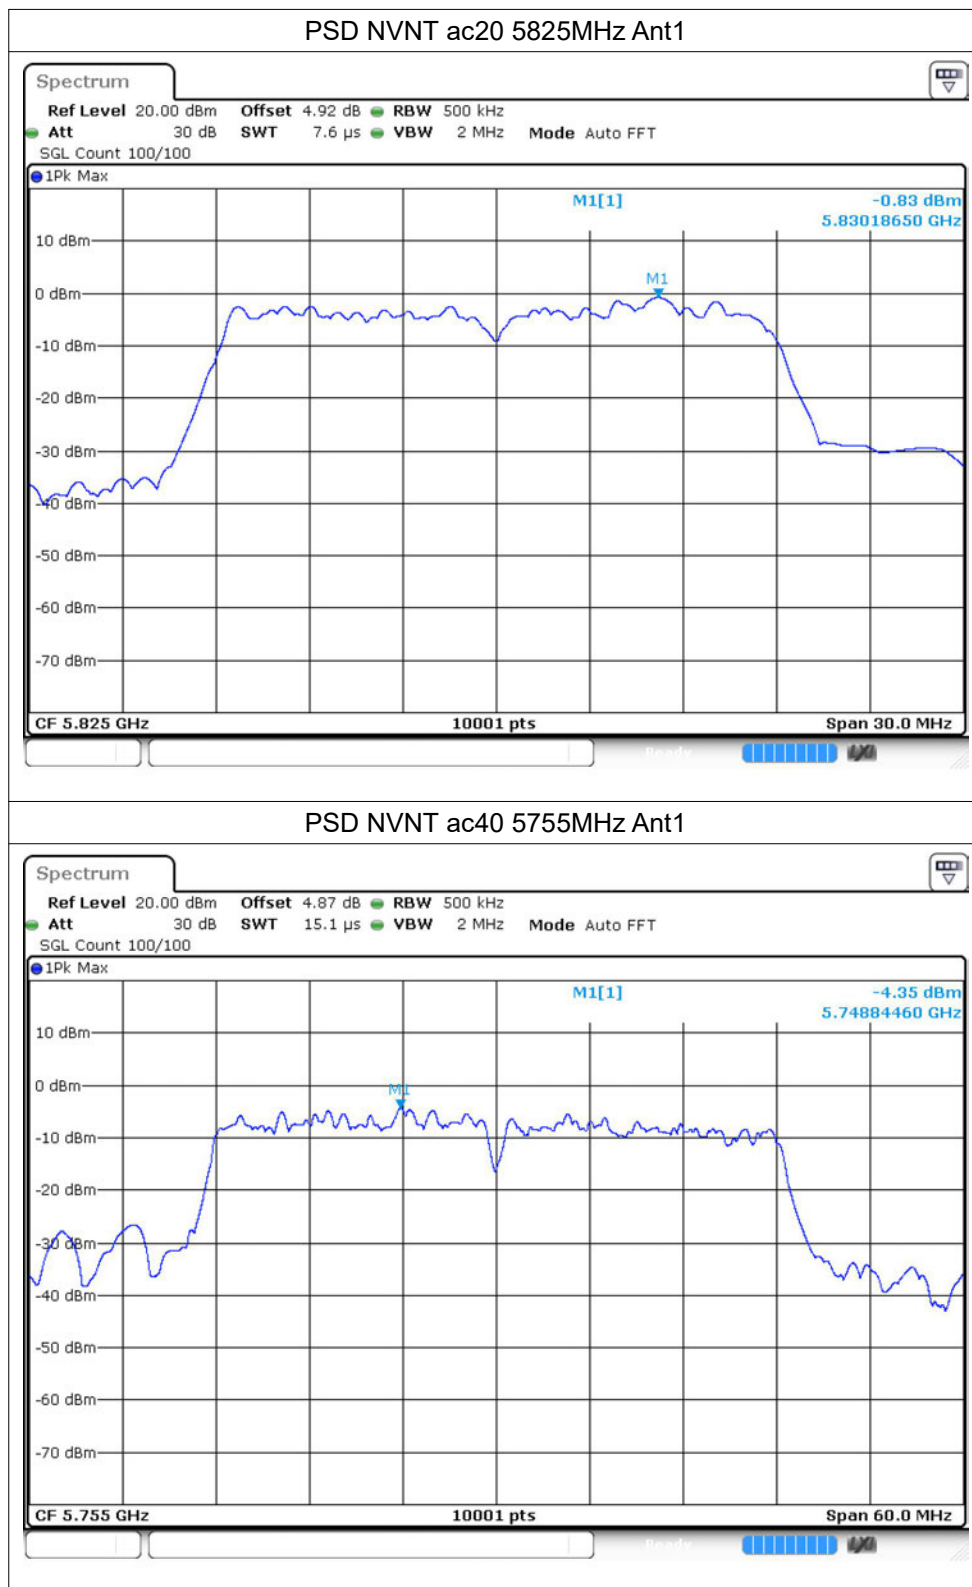

PSD NVNT ac40 5795MHz Ant1

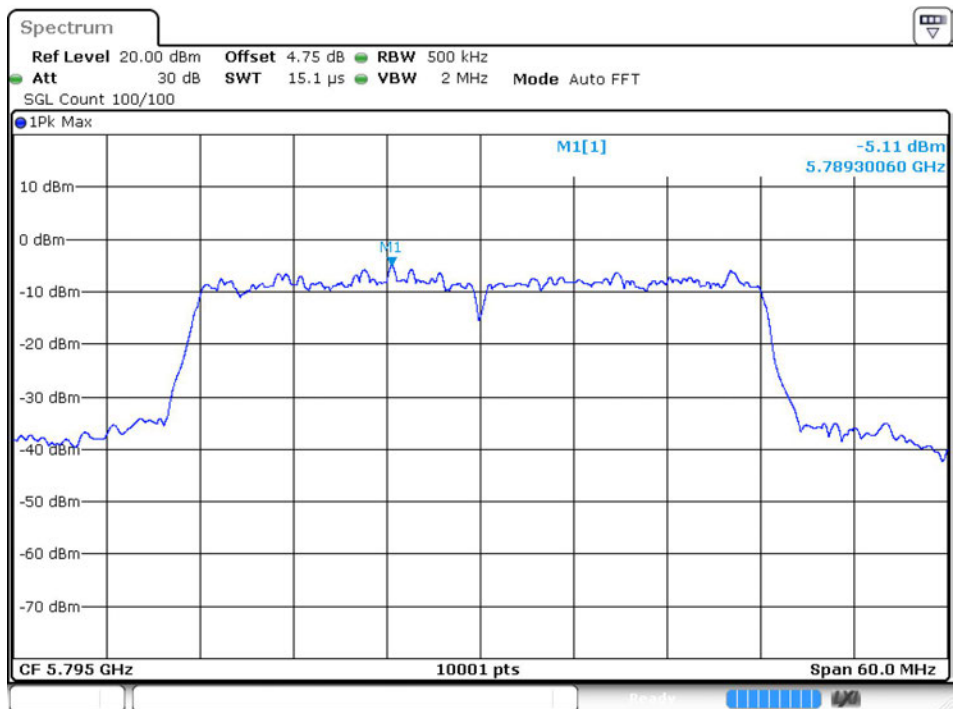

PSD NVNT ac80 5775MHz Ant1

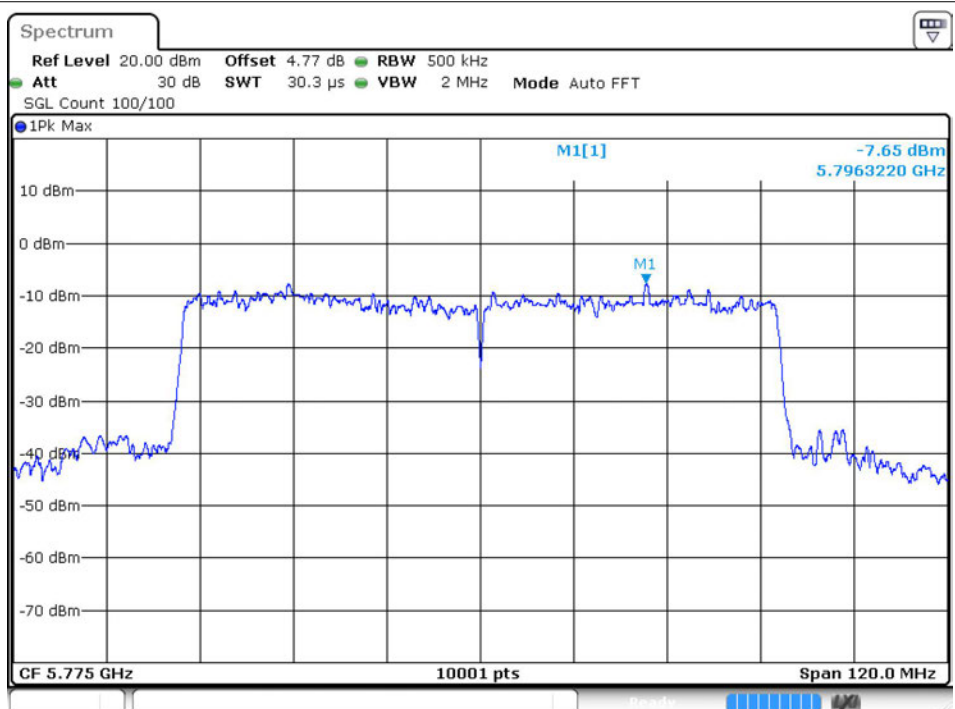




6 Band Edge

Mode	Frequency (MHz)	Antenna	Max Value (dBm)	Verdict
802.11a	5745	Ant1	-30.71	Pass
802.11a	5825	Ant1	-37.1	Pass
802.11n20	5745	Ant1	-29.46	Pass
802.11n20	5825	Ant1	-39.3	Pass
802.11n40	5755	Ant1	-31.09	Pass
802.11n40	5795	Ant1	-39.8	Pass
802.11ac20	5745	Ant1	-33.58	Pass
802.11ac20	5825	Ant1	-39.41	Pass
802.11ac40	5755	Ant1	-32.98	Pass
802.11ac40	5795	Ant1	-38.32	Pass
802.11ac80	5775	Ant1	-39.61	Pass
802.11ac80	5775	Ant1	-33.32	Pass




Test Graphs

Band Edge NVNT a 5745MHz Low Ant1

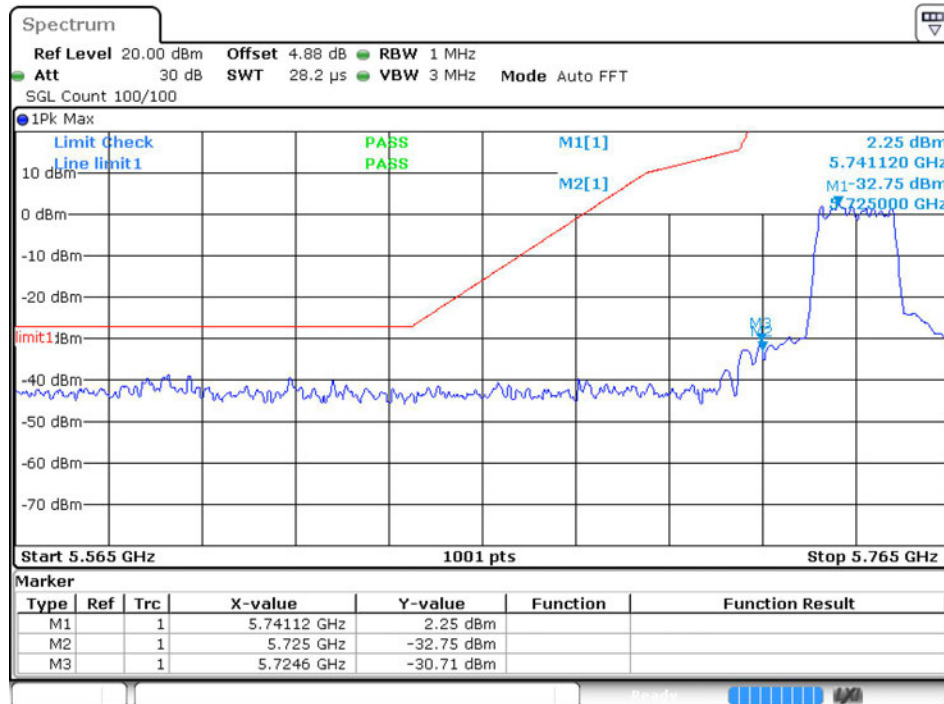


Band Edge NVNT a 5825MHz High Ant1

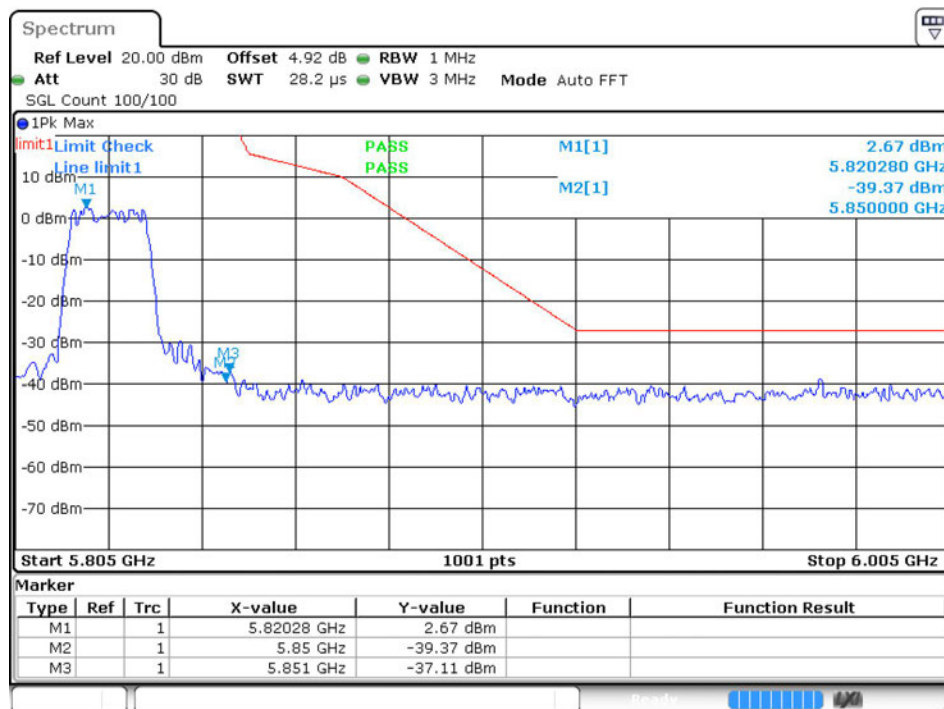




Band Edge NVNT n20 5745MHz Low Ant1

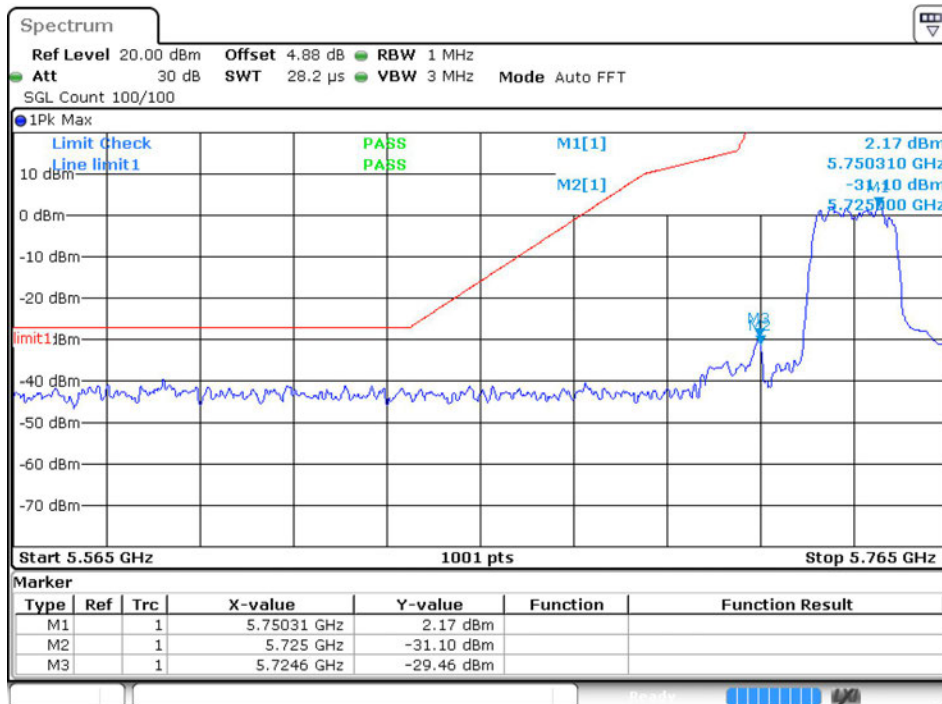


Band Edge NVNT n20 5825MHz High Ant1

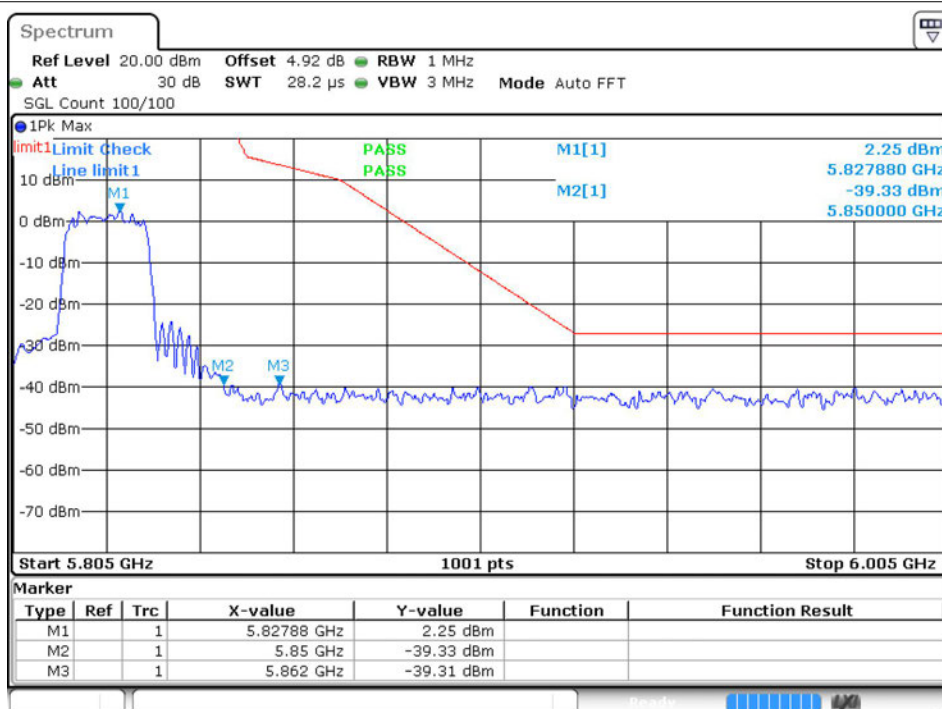




Band Edge NVNT n40 5755MHz Low Ant1

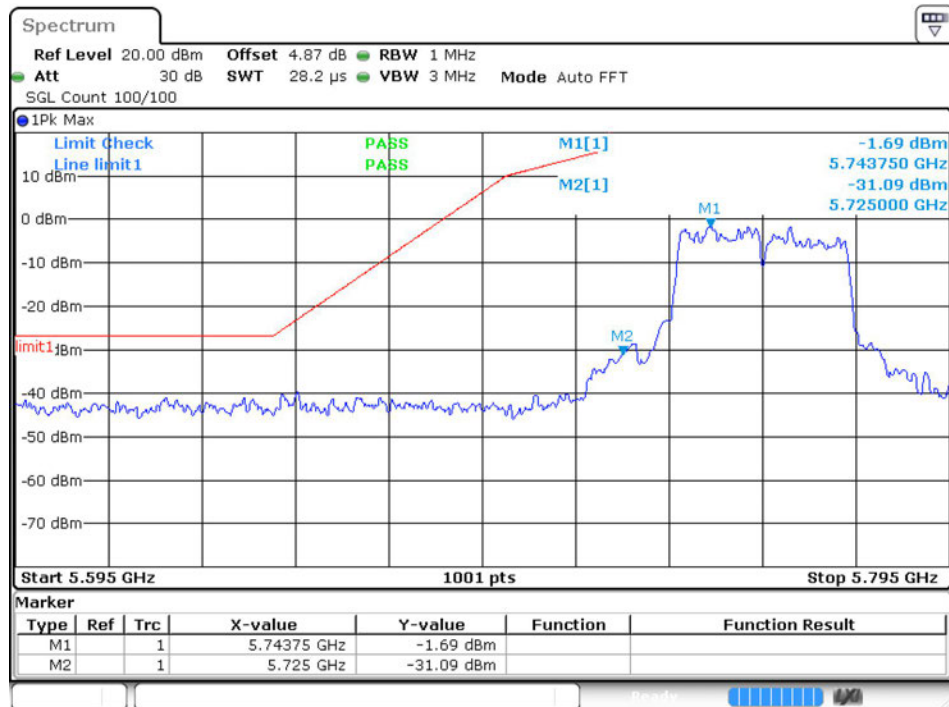


Band Edge NVNT n40 5795MHz High Ant1

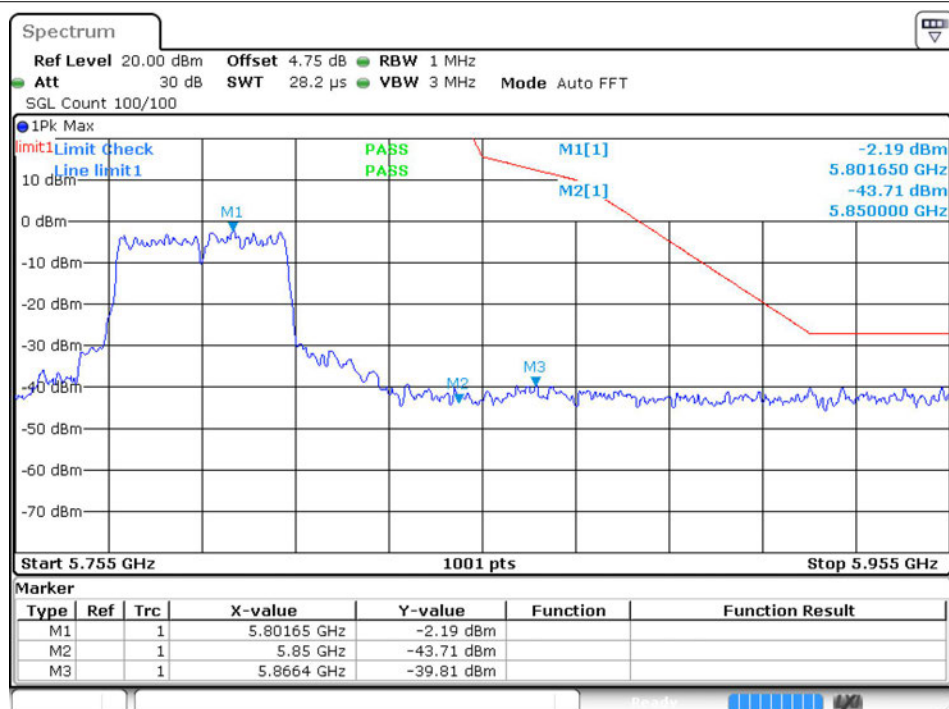




Band Edge NVNT ac20 5745MHz Low Ant1

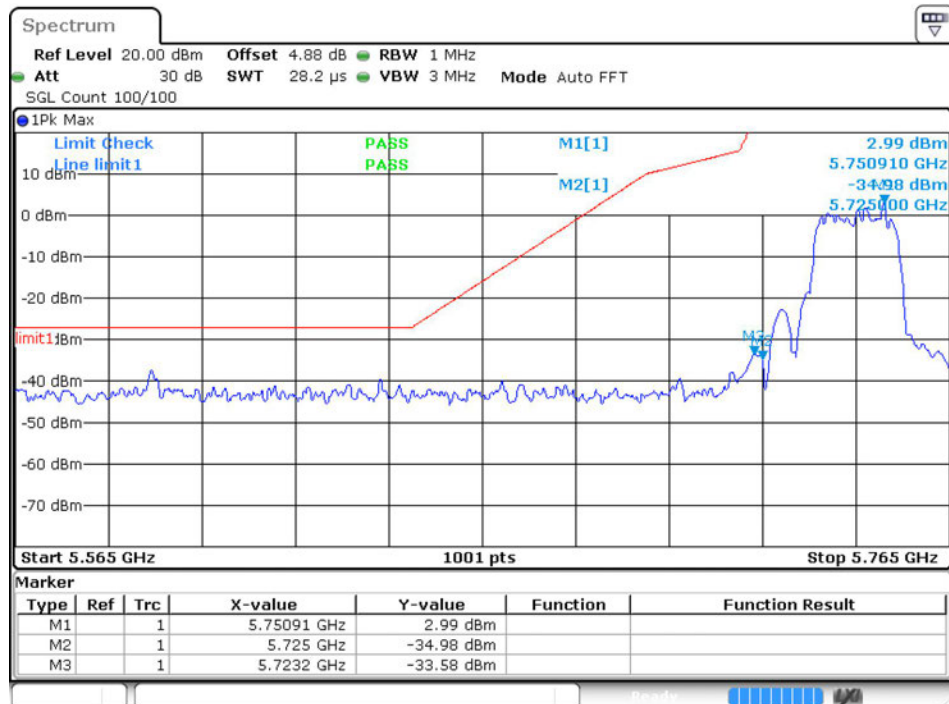


Band Edge NVNT ac20 5825MHz High Ant1

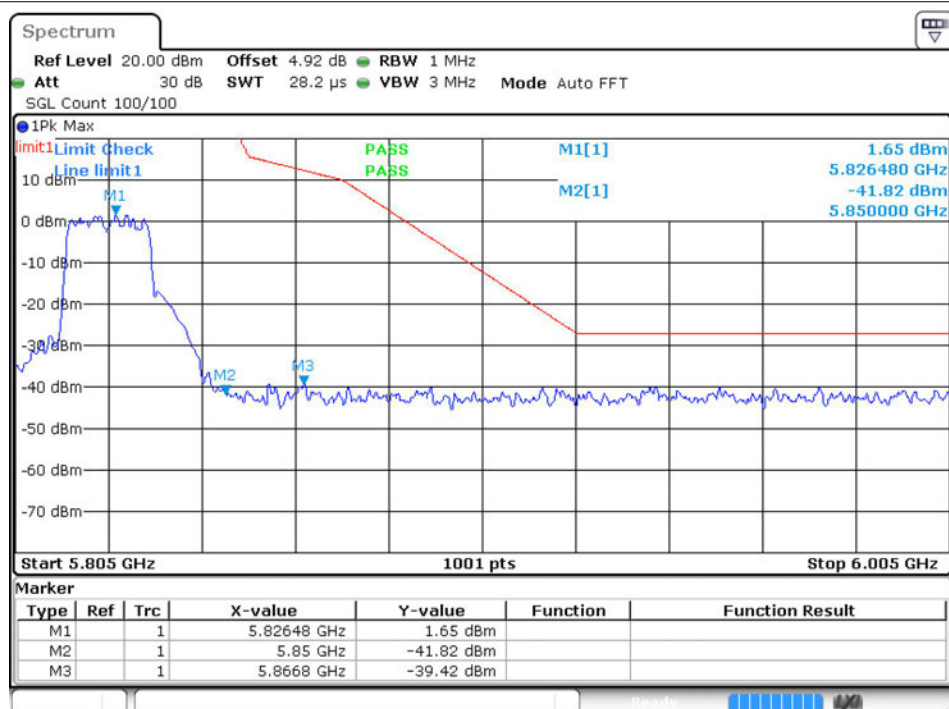




Band Edge NVNT ac40 5755MHz Low Ant1

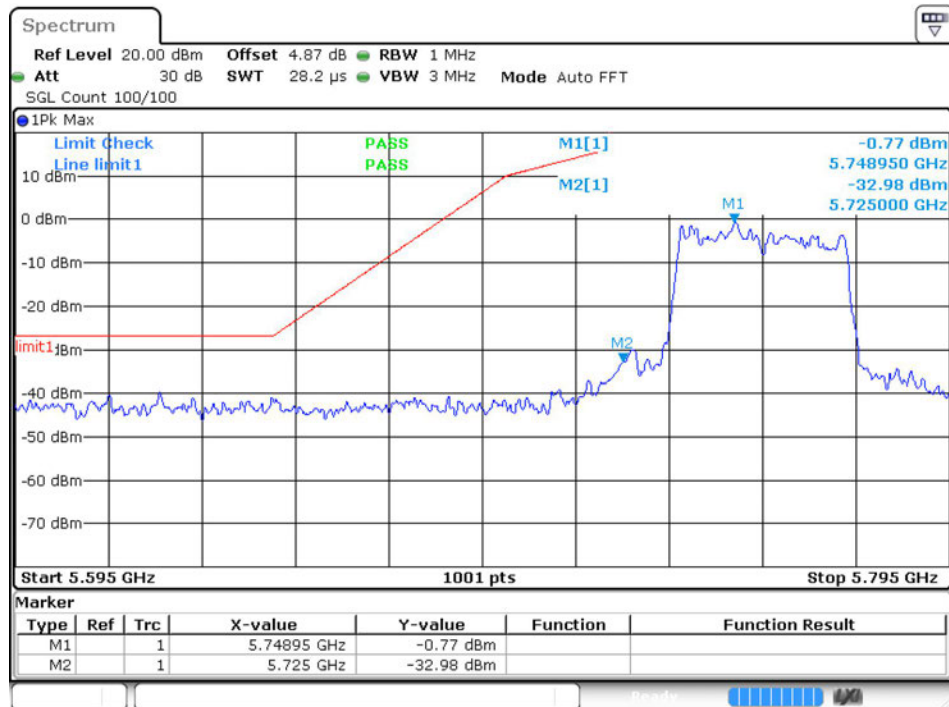


Band Edge NVNT ac40 5795MHz High Ant1

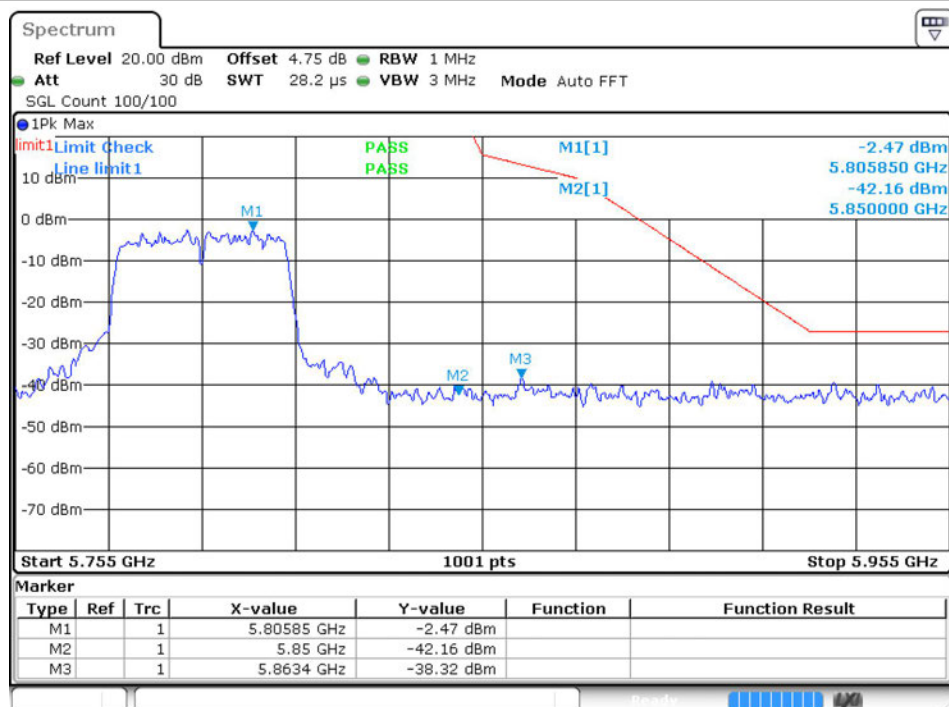




Band Edge NVNT ac80 5775MHz High Ant1

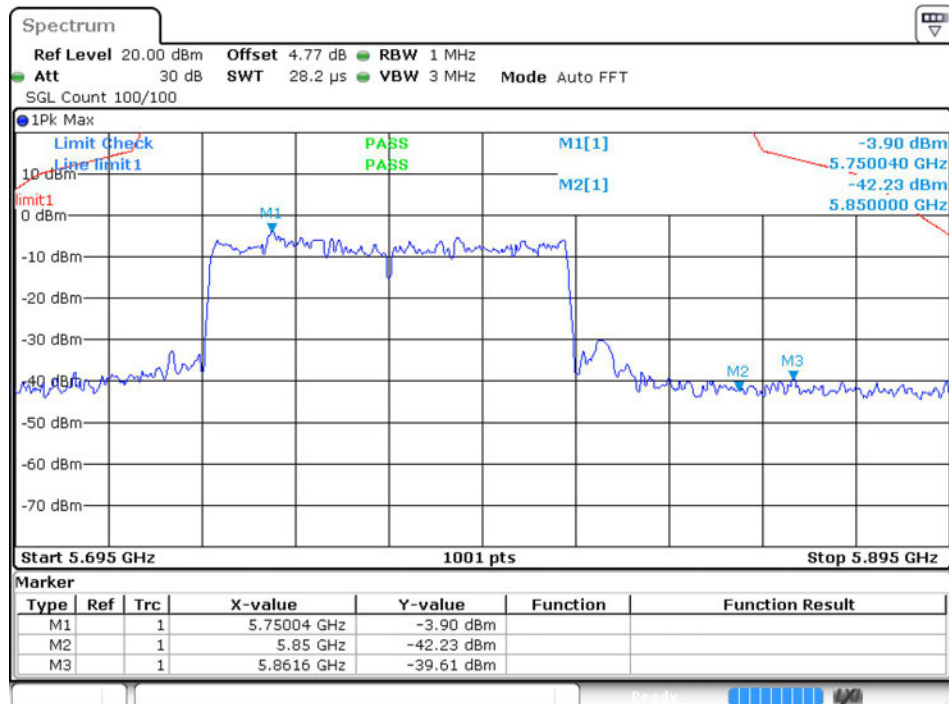

Band Edge NVNT ac80 5775MHz Low Ant1

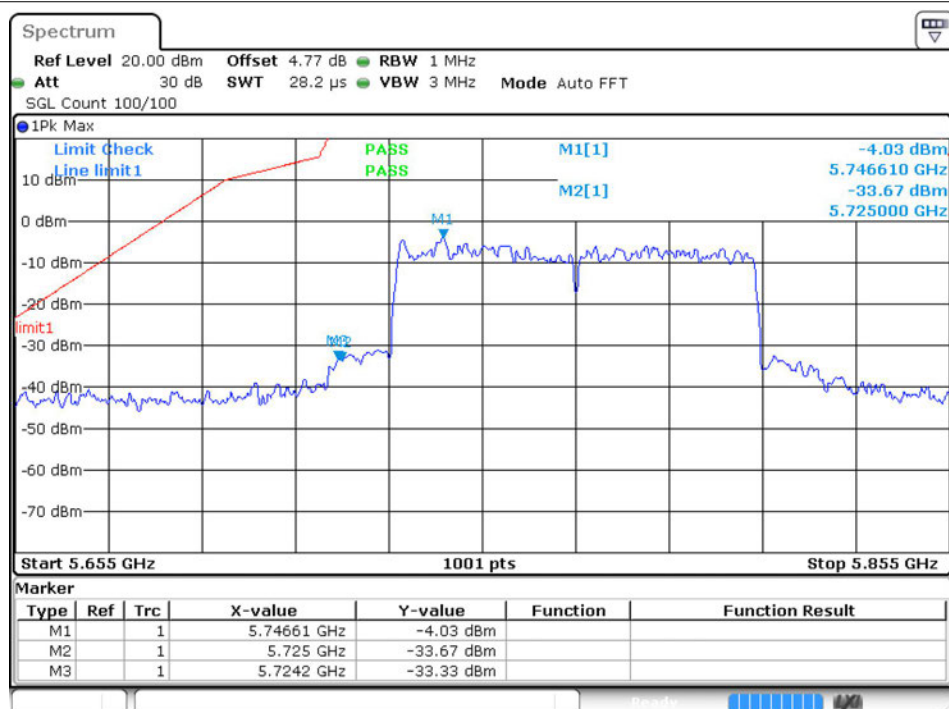



7 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 120V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 138V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
-20C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-10C 120V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
0C 120V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
10C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
30C 120V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
40C 120V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
50C 120V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 102V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 120V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 138V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
-20C 120V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
-10C 120V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
0C 120V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
10C 120V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
30C 120V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
40C 120V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
50C 120V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 102V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 120V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 138V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-20C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-10C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
0C 120V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
10C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
30C 120V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
40C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
50C 120V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 102V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 120V	n20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 138V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-20C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-10C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
0C 120V	n20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
10C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
30C 120V	n20	5745	Ant1	5744.96	-40000	-6.96	25	Pass



40C 120V	n20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
50C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 102V	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 120V	n20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 138V	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
-20C 120V	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
-10C 120V	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
0C 120V	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
10C 120V	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
30C 120V	n20	5785	Ant1	5785	0	0	25	Pass
40C 120V	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
50C 120V	n20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 102V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 120V	n20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 138V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-20C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-10C 120V	n20	5825	Ant1	5825	0	0	25	Pass
0C 120V	n20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
10C 120V	n20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
30C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
40C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
50C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 102V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 138V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-20C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-10C 120V	n40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
0C 120V	n40	5755	Ant1	5755	0	0	25	Pass
10C 120V	n40	5755	Ant1	5755	0	0	25	Pass
30C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
40C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
50C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 102V	n40	5795	Ant1	5795	0	0	25	Pass
20C 120V	n40	5795	Ant1	5795	0	0	25	Pass
20C 138V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
-20C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
-10C 120V	n40	5795	Ant1	5795	0	0	25	Pass
0C 120V	n40	5795	Ant1	5795.04	40000	6.9	25	Pass
10C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
30C 120V	n40	5795	Ant1	5795	0	0	25	Pass
40C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
50C 120V	n40	5795	Ant1	5795	0	0	25	Pass
20C 102V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass



20C 138V	ac20	5745	Ant1	5745	0	0	25	Pass
-20C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-10C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
0C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
10C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
30C 120V	ac20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
40C 120V	ac20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
50C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 102V	ac20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 120V	ac20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 138V	ac20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
-20C 120V	ac20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
-10C 120V	ac20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
0C 120V	ac20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
10C 120V	ac20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
30C 120V	ac20	5785	Ant1	5785	0	0	25	Pass
40C 120V	ac20	5785	Ant1	5785	0	0	25	Pass
50C 120V	ac20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 102V	ac20	5825	Ant1	5825	0	0	25	Pass
20C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 138V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-20C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-10C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
0C 120V	ac20	5825	Ant1	5825	0	0	25	Pass
10C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
30C 120V	ac20	5825	Ant1	5825	0	0	25	Pass
40C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
50C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 102V	ac40	5755	Ant1	5755	0	0	25	Pass
20C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 138V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-20C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-10C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
0C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
10C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
30C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
40C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
50C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 102V	ac40	5795	Ant1	5795	0	0	25	Pass
20C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 138V	ac40	5795	Ant1	5795	0	0	25	Pass
-20C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
-10C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
0C 120V	ac40	5795	Ant1	5795	0	0	25	Pass




10C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
30C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
40C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
50C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 102V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
20C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 138V	ac80	5775	Ant1	5775	0	0	25	Pass
-20C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
-10C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
0C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
10C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
30C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
40C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
50C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass




Test Graphs

Freq. Stability 20C 102V a 5745MHz Ant1

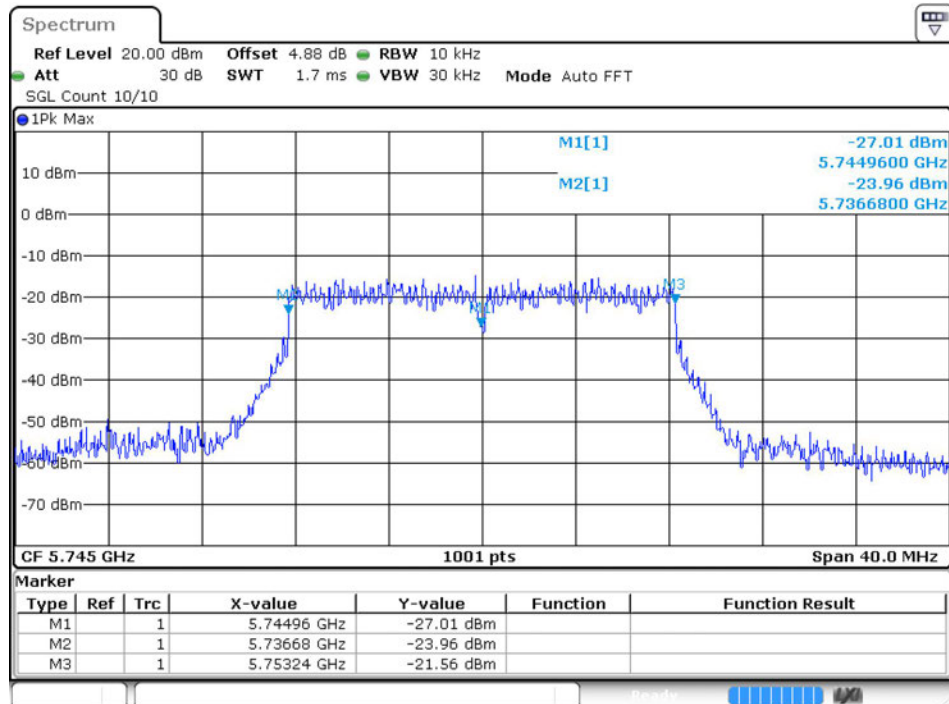


Freq. Stability 20C 120V a 5745MHz Ant1

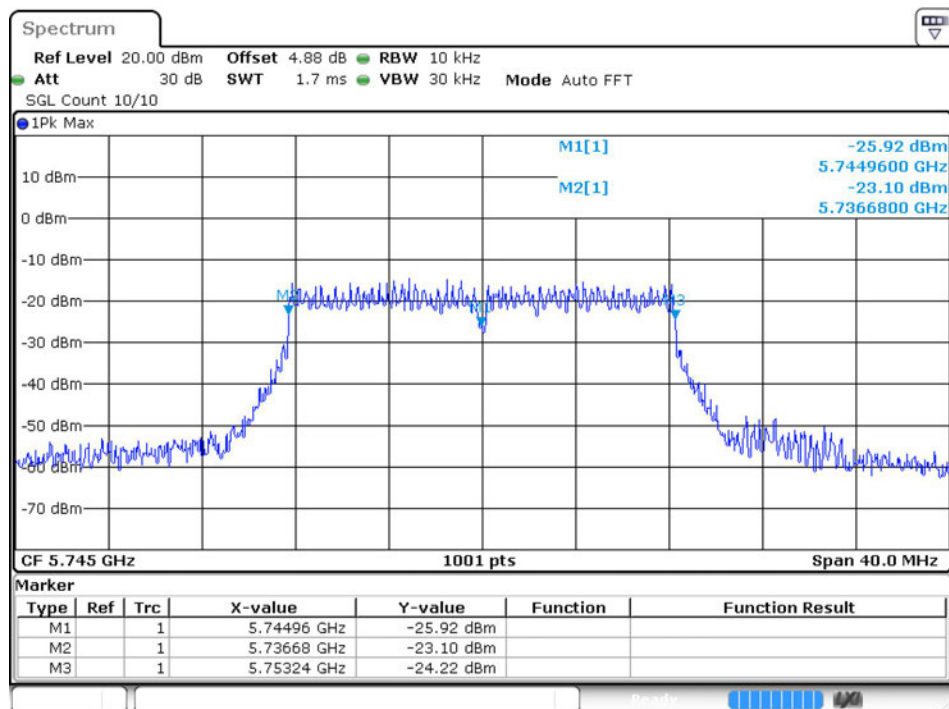




Freq. Stability 20C 138V a 5745MHz Ant1

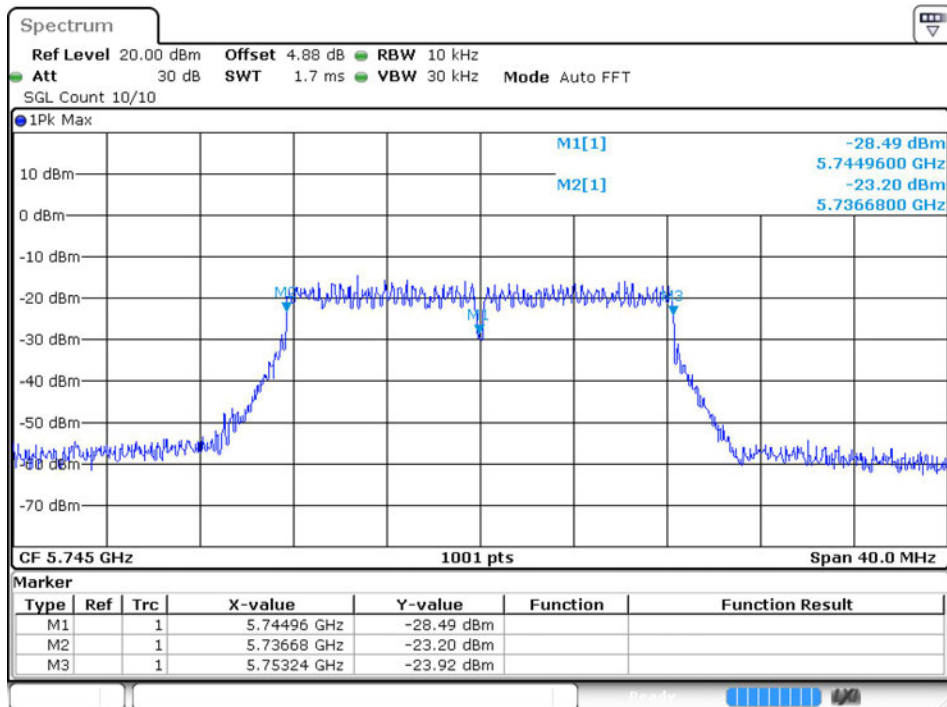


Freq. Stability -20C 120V a 5745MHz Ant1

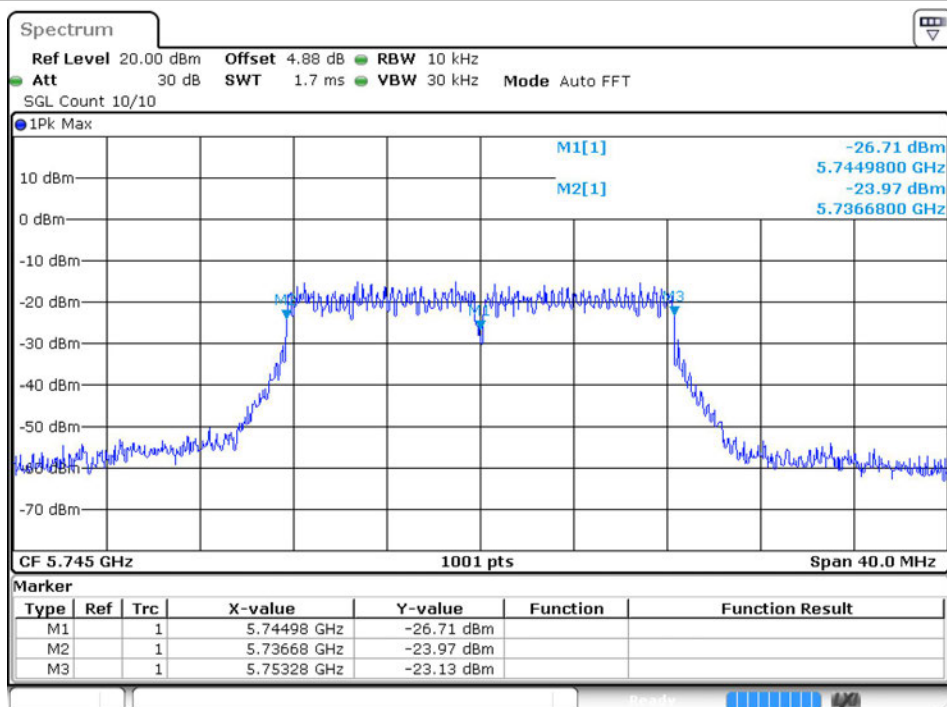




Freq. Stability -10C 120V a 5745MHz Ant1

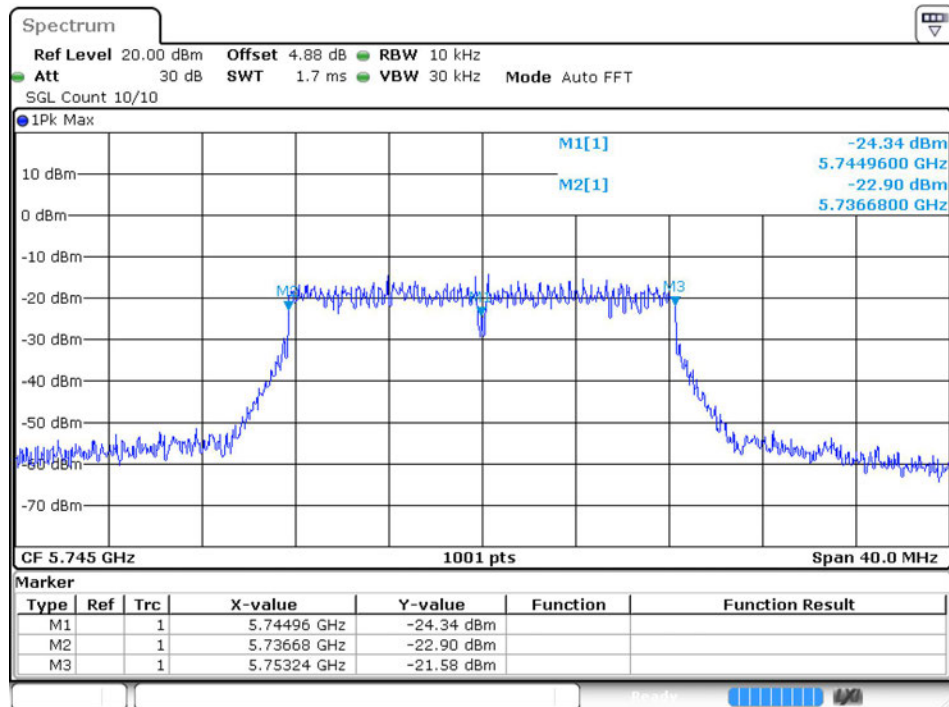


Freq. Stability 0C 120V a 5745MHz Ant1

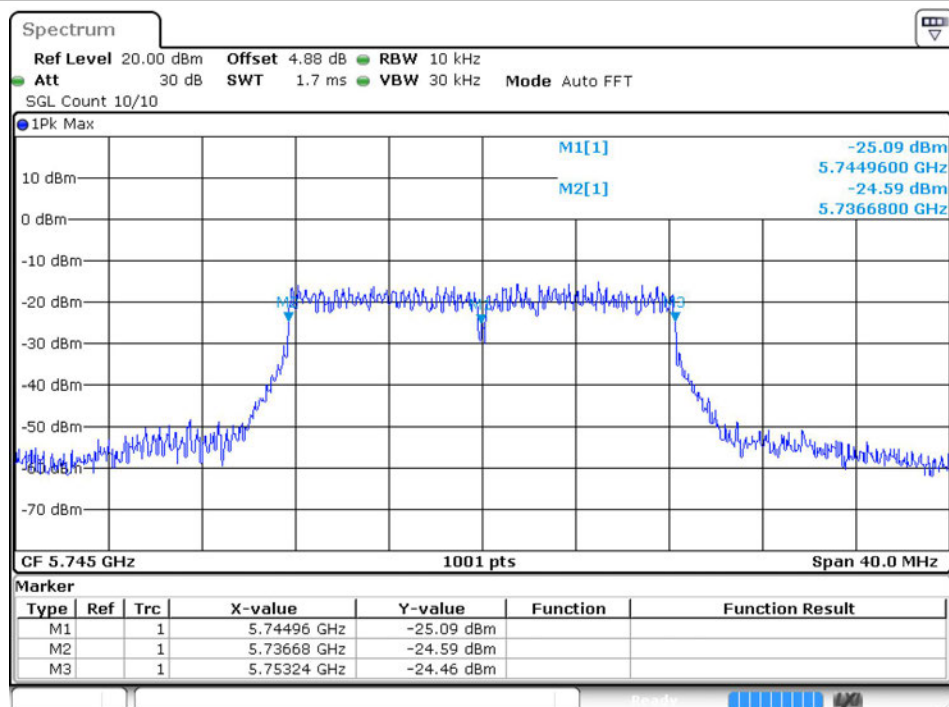




Freq. Stability 10C 120V a 5745MHz Ant1

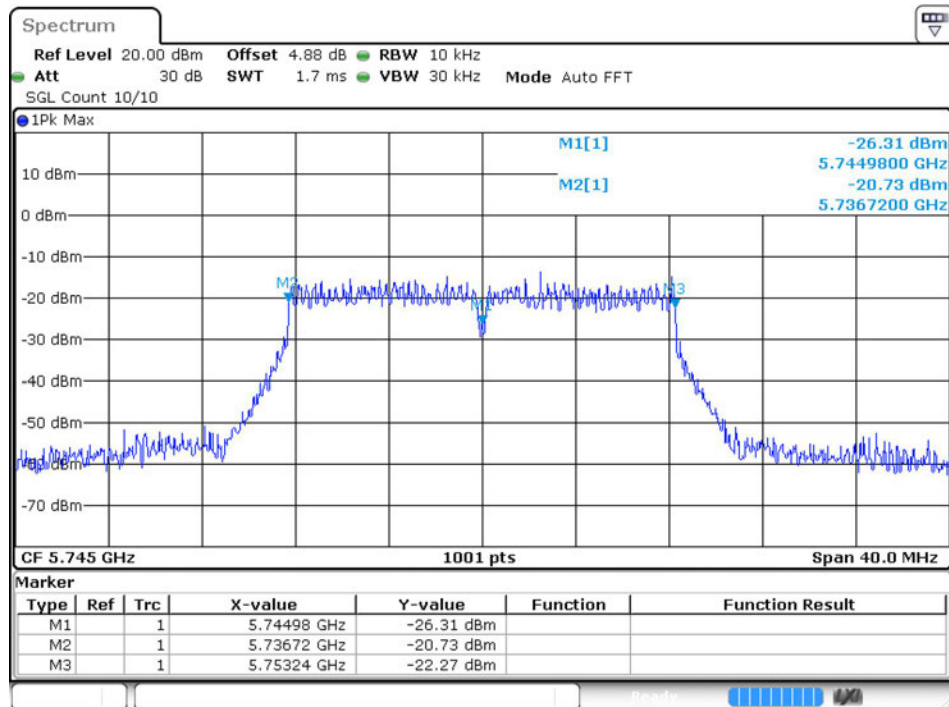


Freq. Stability 30C 120V a 5745MHz Ant1

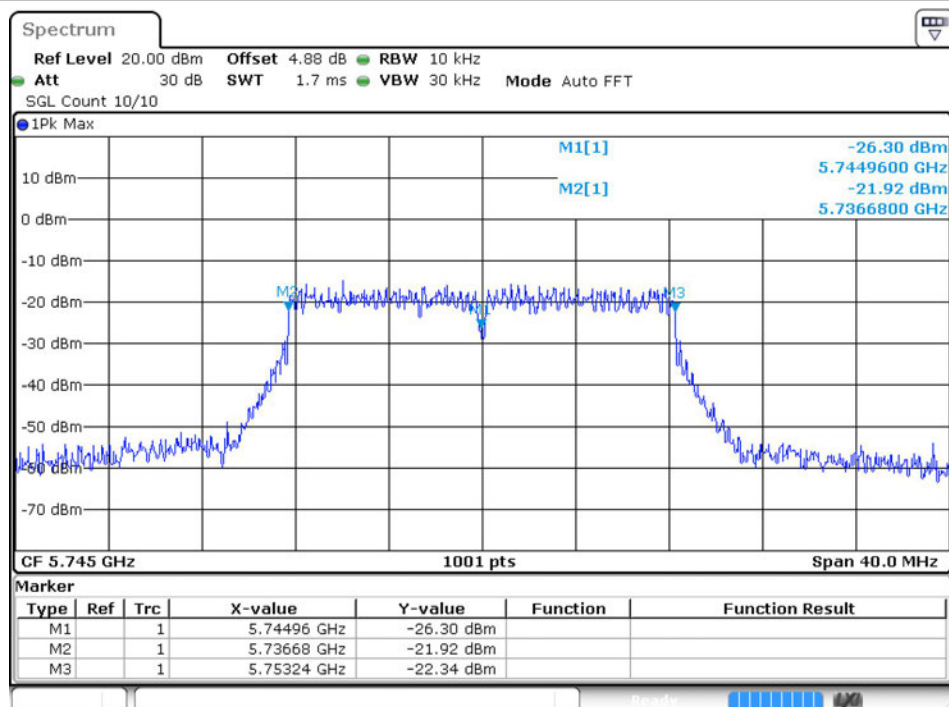




Freq. Stability 40C 120V a 5745MHz Ant1

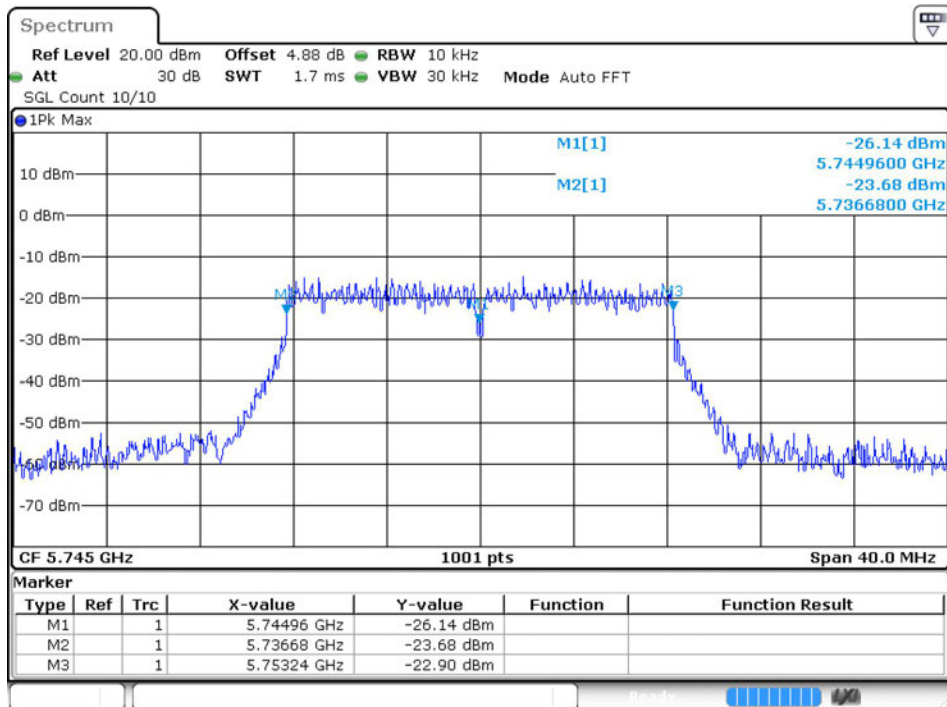


Freq. Stability 50C 120V a 5745MHz Ant1

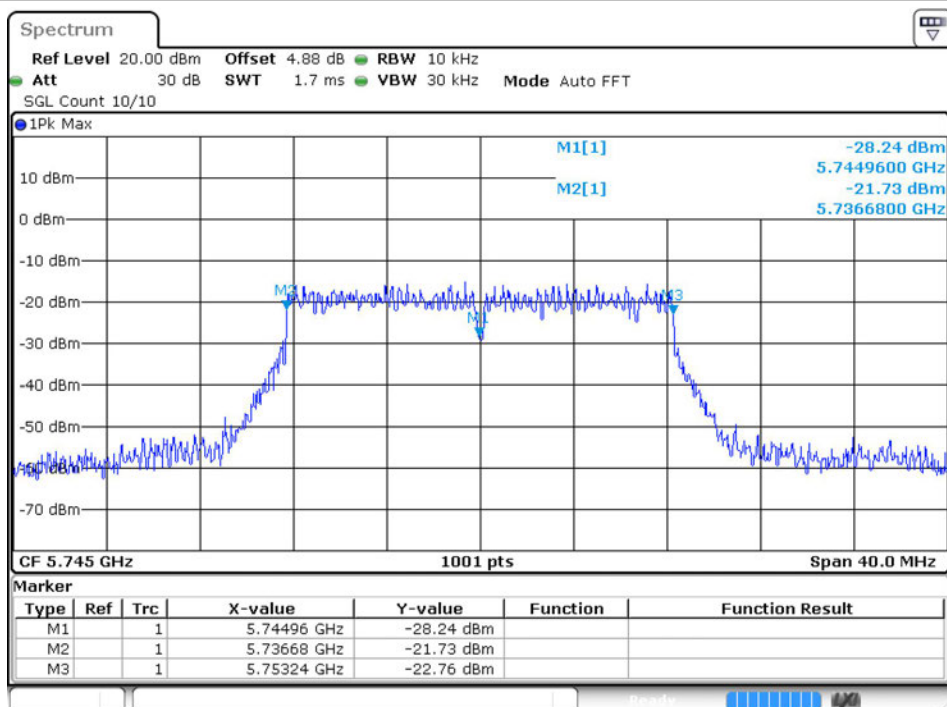




Freq. Stability 20C 102V a 5785MHz Ant1

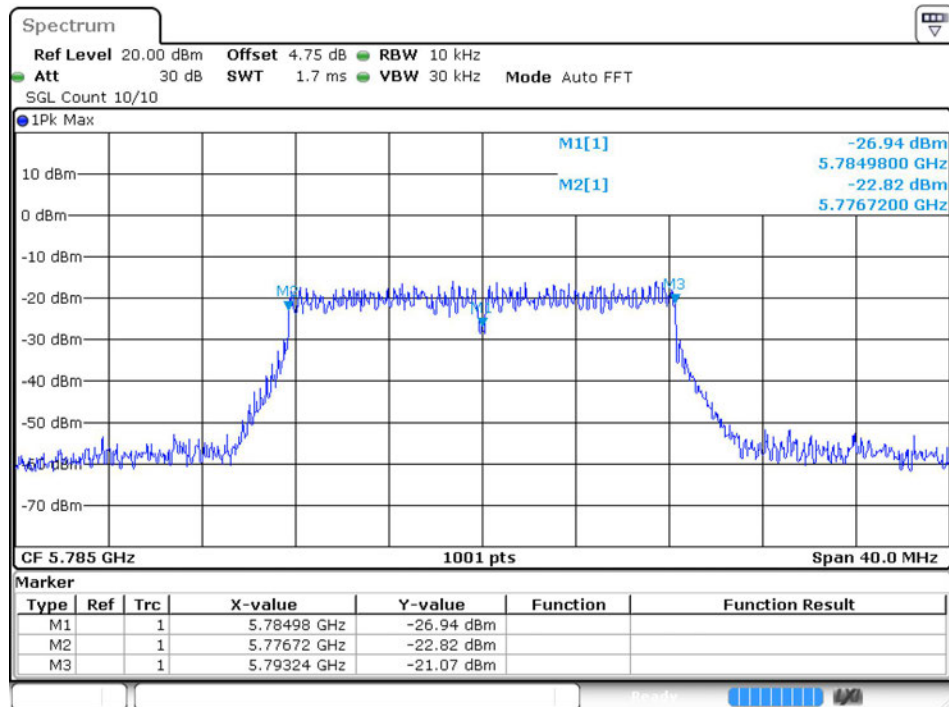


Freq. Stability 20C 120V a 5785MHz Ant1

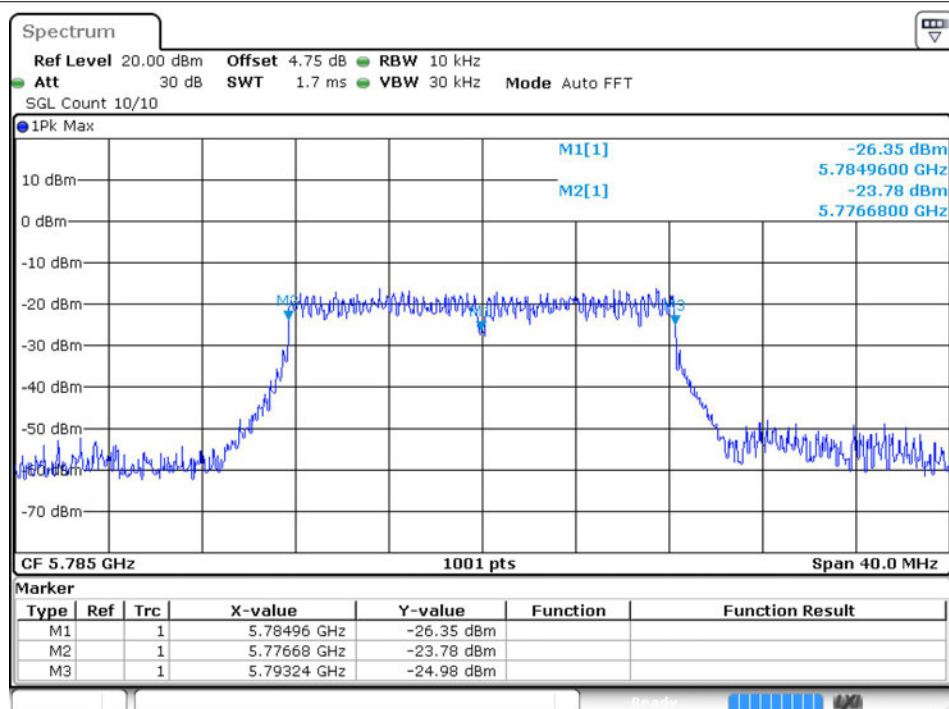




Freq. Stability 20C 138V a 5785MHz Ant1

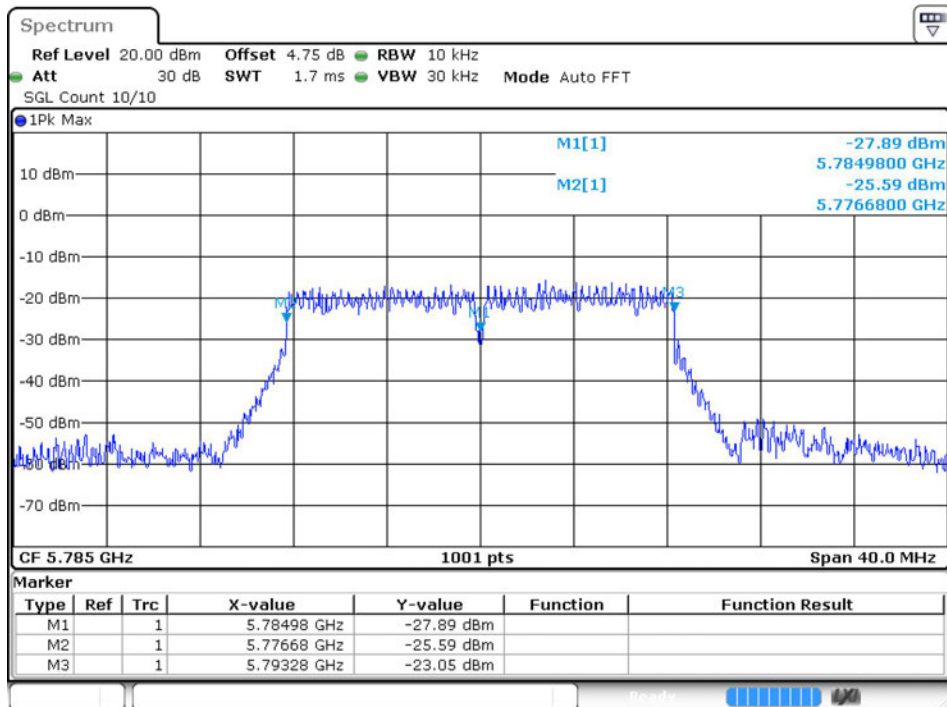


Freq. Stability -20C 120V a 5785MHz Ant1

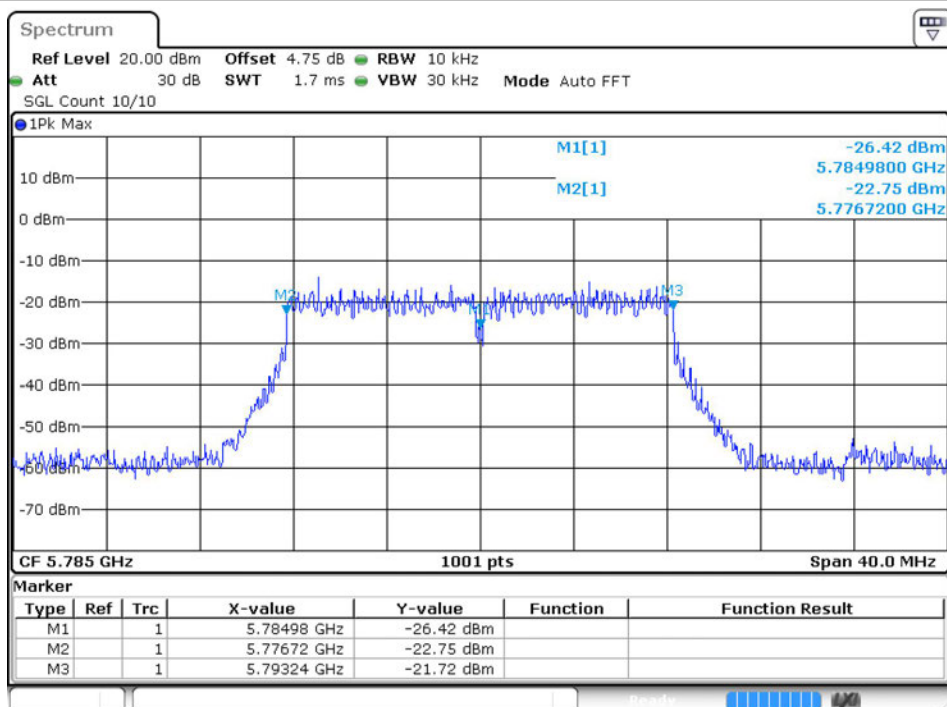




Freq. Stability -10C 120V a 5785MHz Ant1

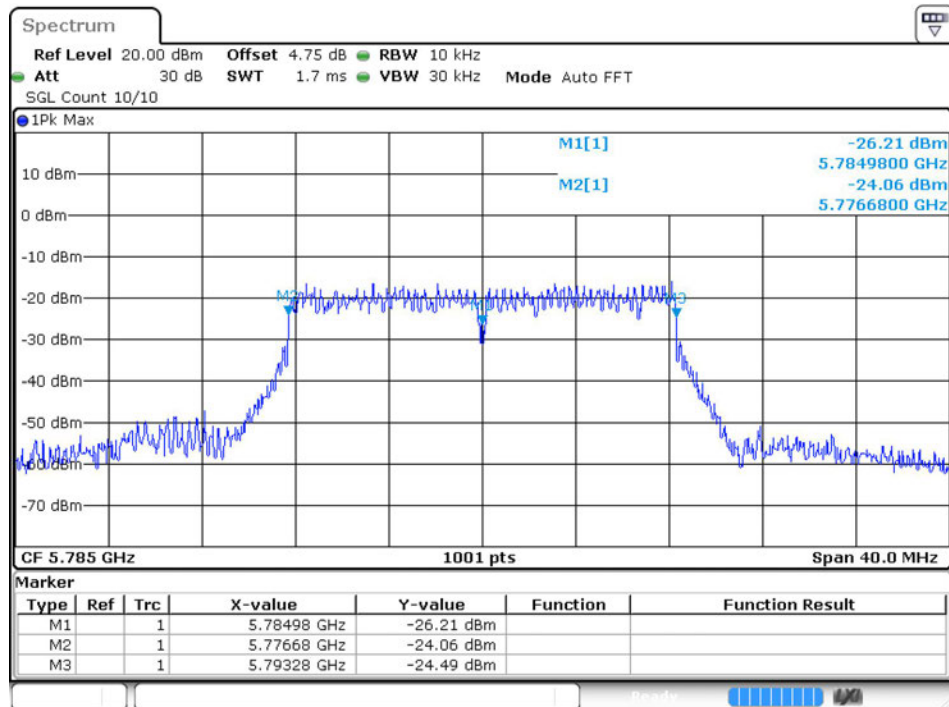


Freq. Stability 0C 120V a 5785MHz Ant1

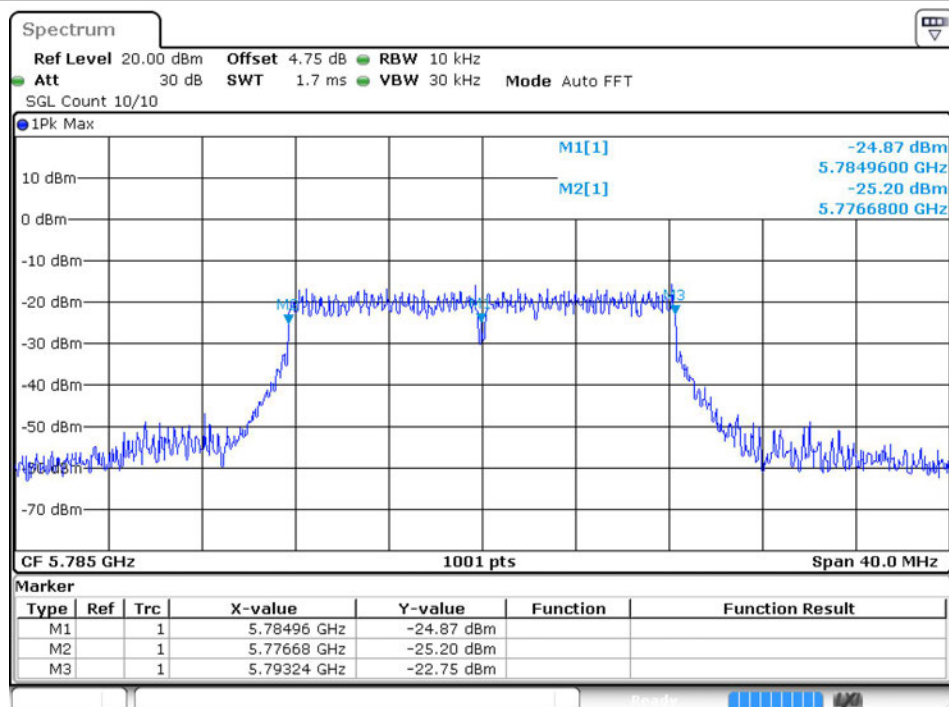




Freq. Stability 10C 120V a 5785MHz Ant1

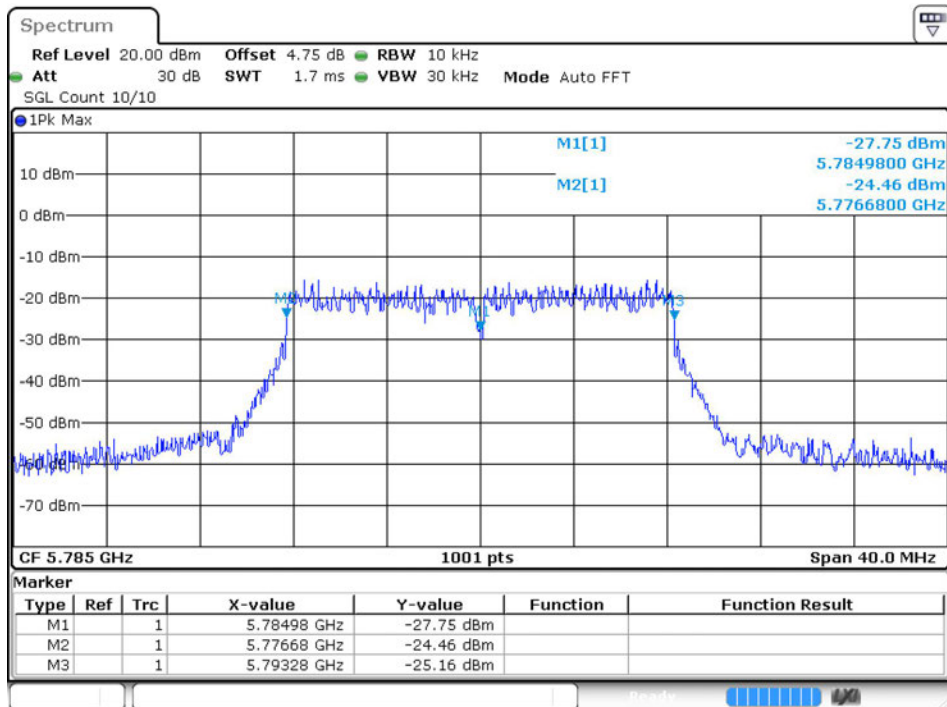


Freq. Stability 30C 120V a 5785MHz Ant1

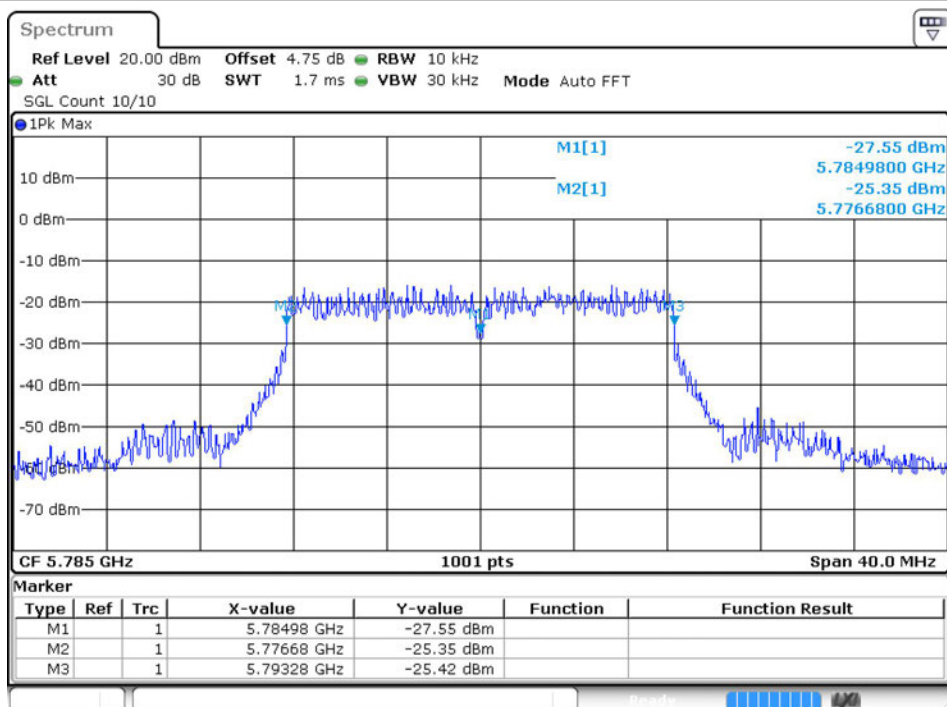




Freq. Stability 40C 120V a 5785MHz Ant1

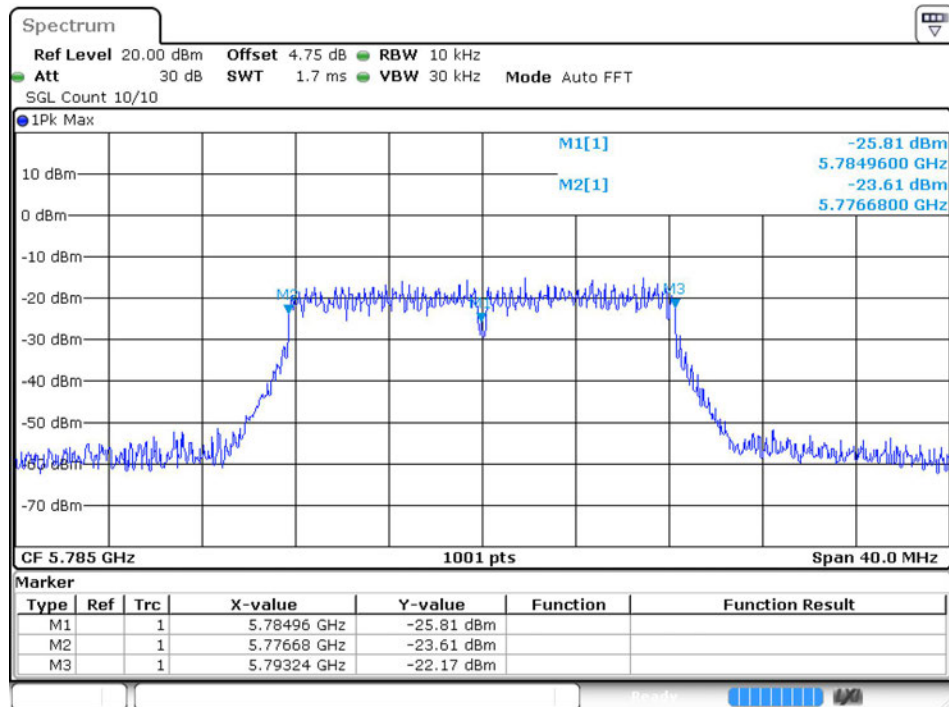


Freq. Stability 50C 120V a 5785MHz Ant1

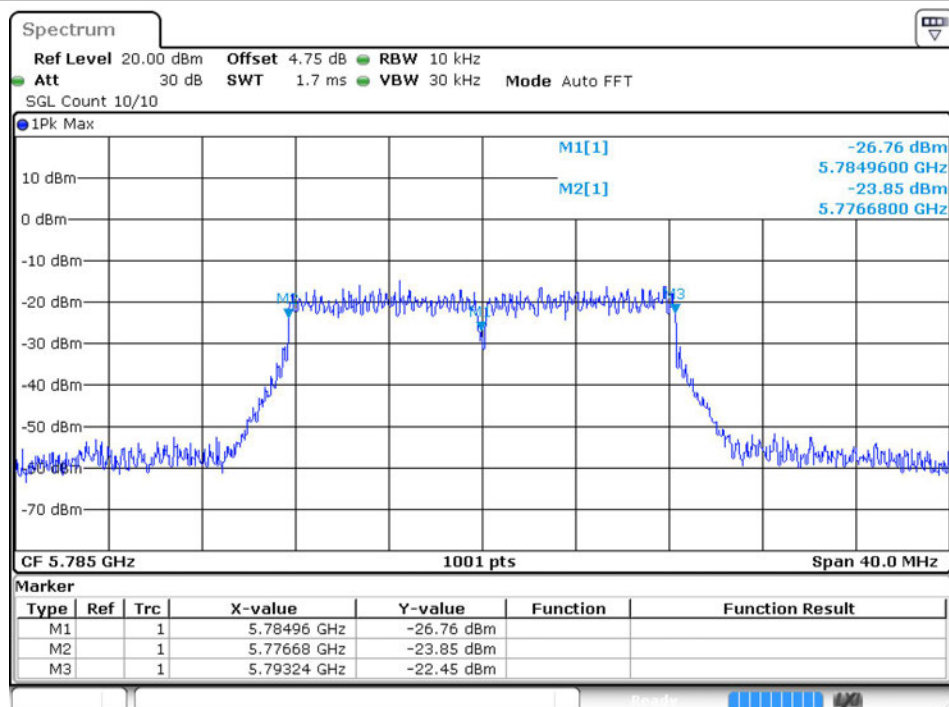




Freq. Stability 20C 102V a 5825MHz Ant1

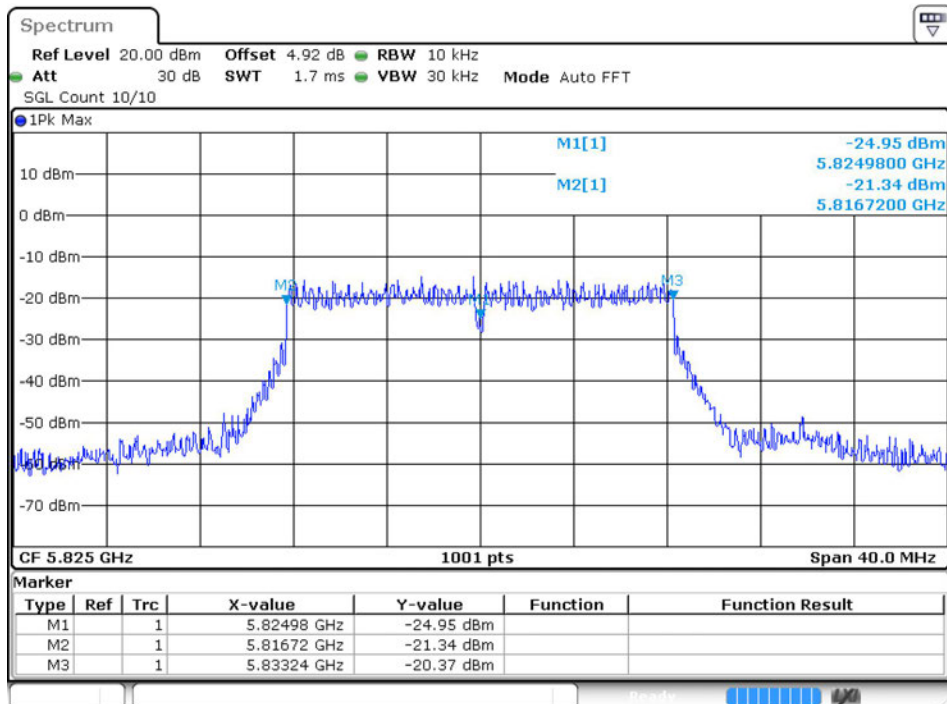


Freq. Stability 20C 120V a 5825MHz Ant1

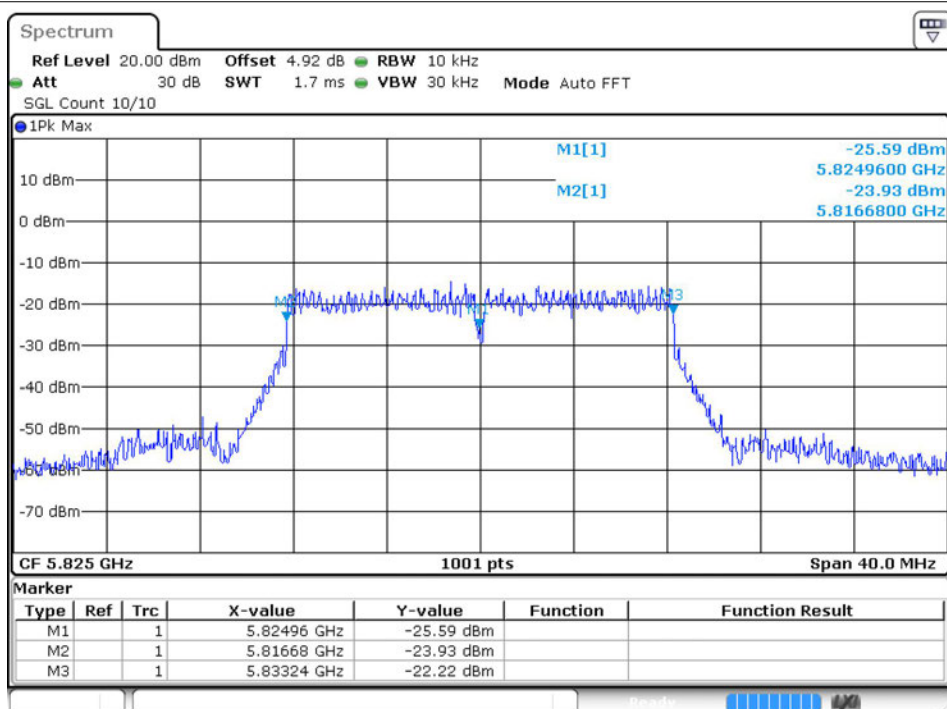




Freq. Stability 20C 138V a 5825MHz Ant1

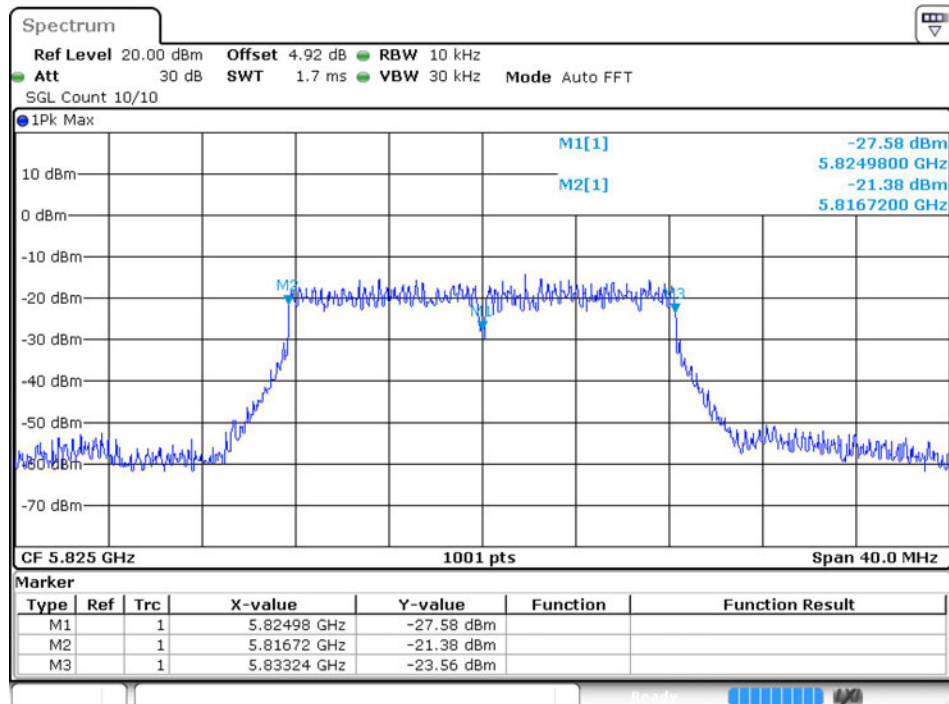


Freq. Stability -20C 120V a 5825MHz Ant1

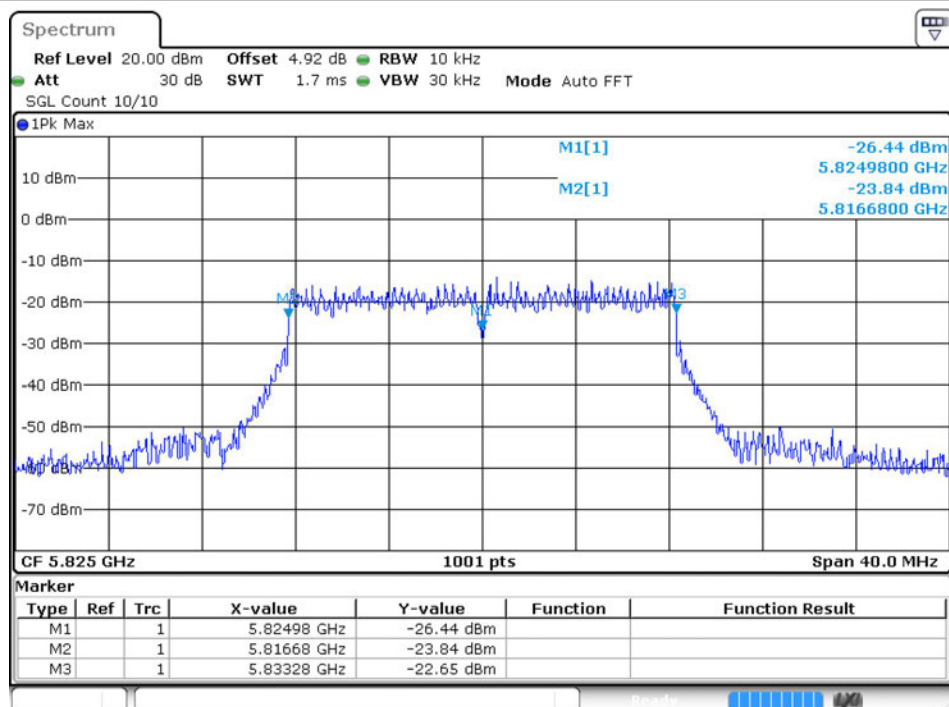




Freq. Stability -10C 120V a 5825MHz Ant1

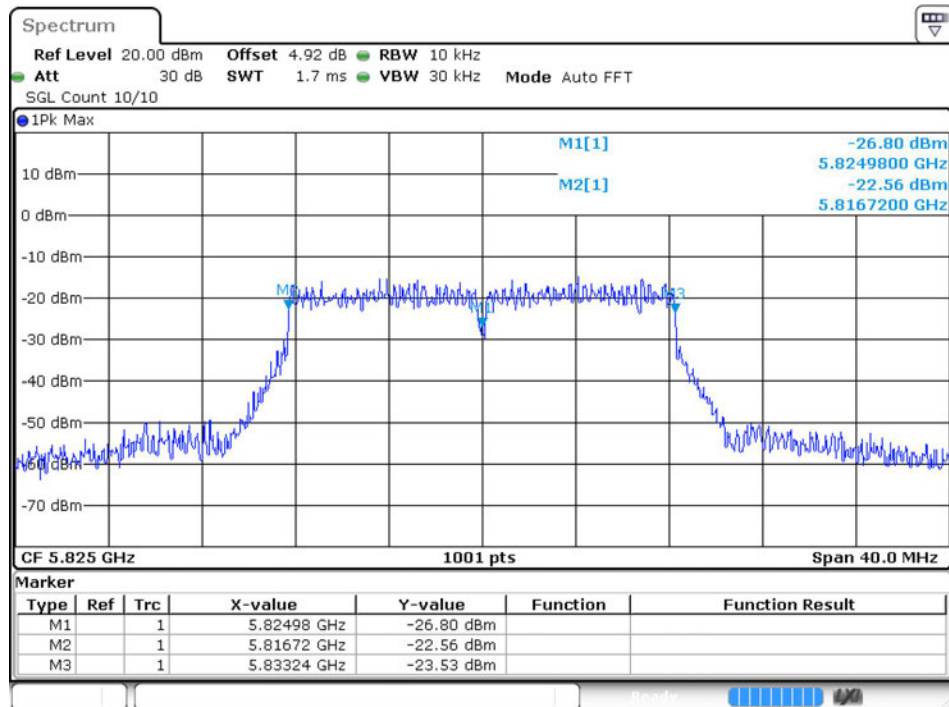


Freq. Stability 0C 120V a 5825MHz Ant1

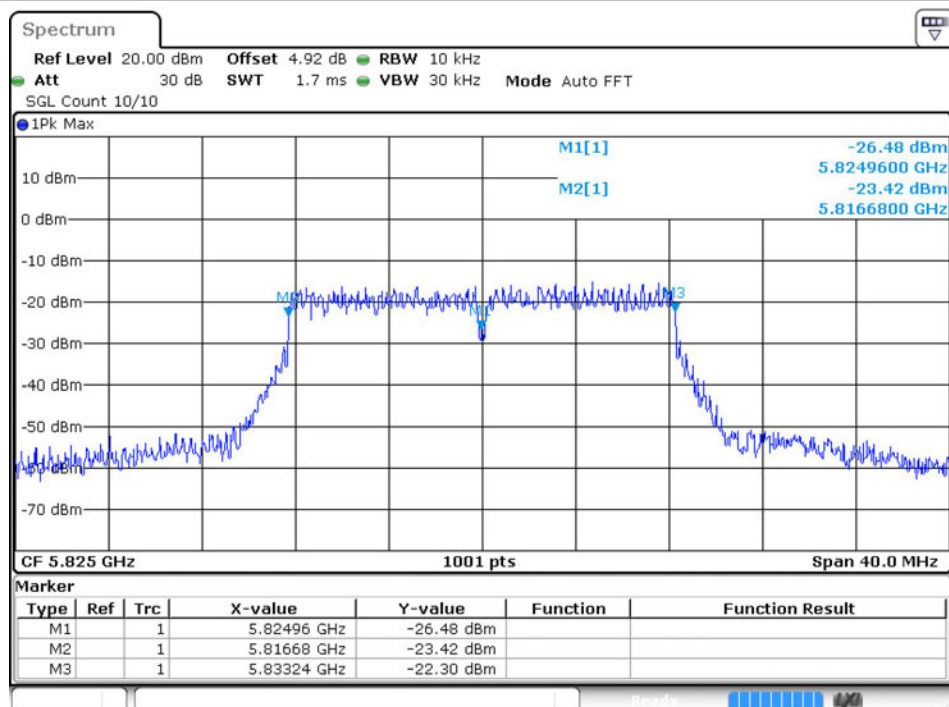




Freq. Stability 10C 120V a 5825MHz Ant1

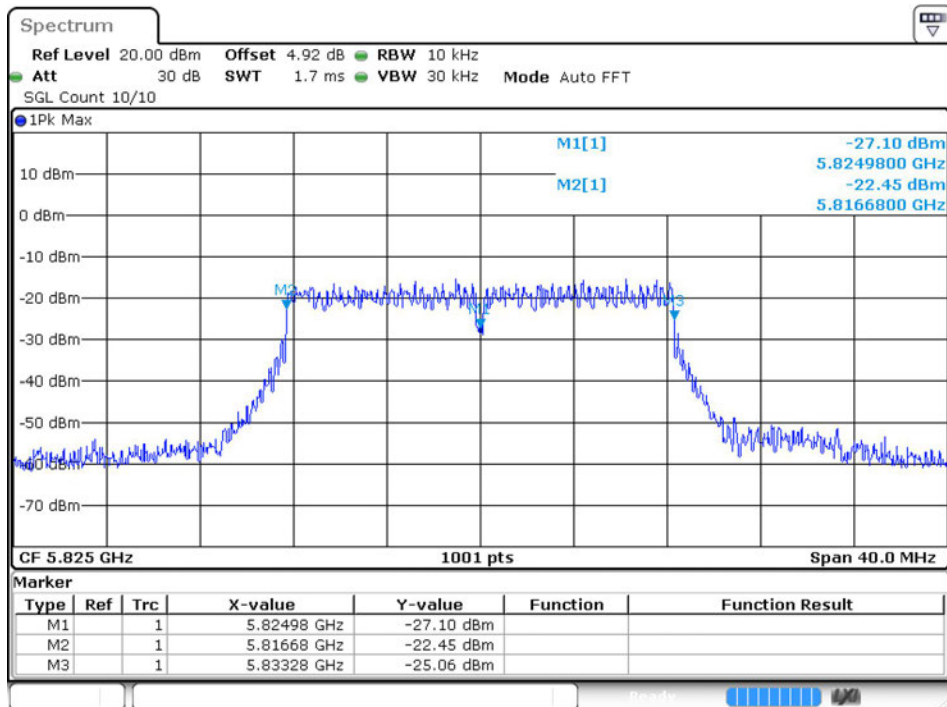


Freq. Stability 30C 120V a 5825MHz Ant1

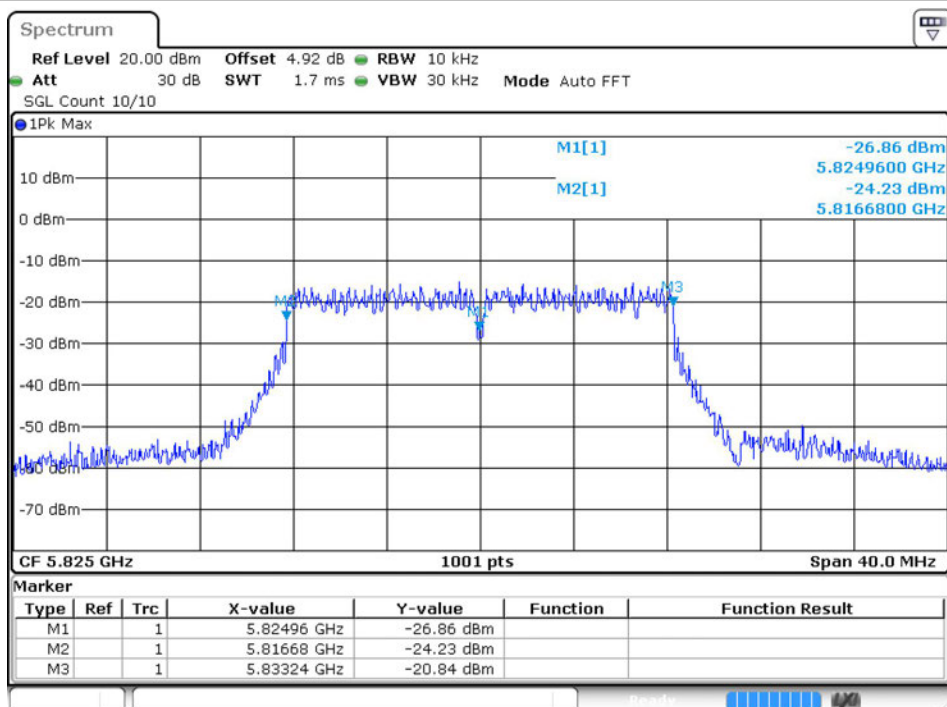




Freq. Stability 40C 120V a 5825MHz Ant1

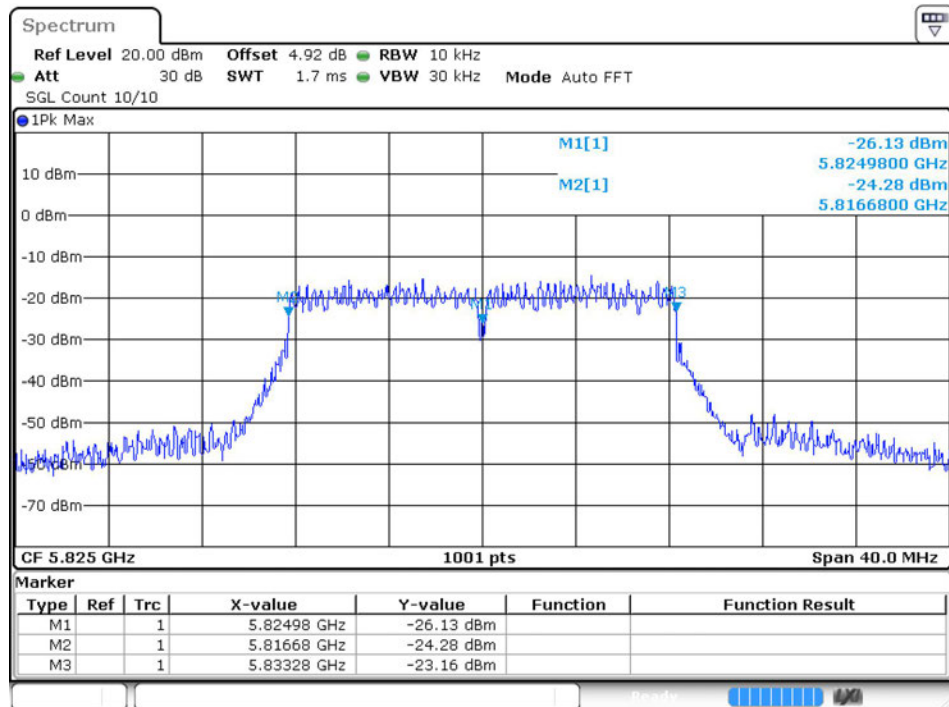


Freq. Stability 50C 120V a 5825MHz Ant1

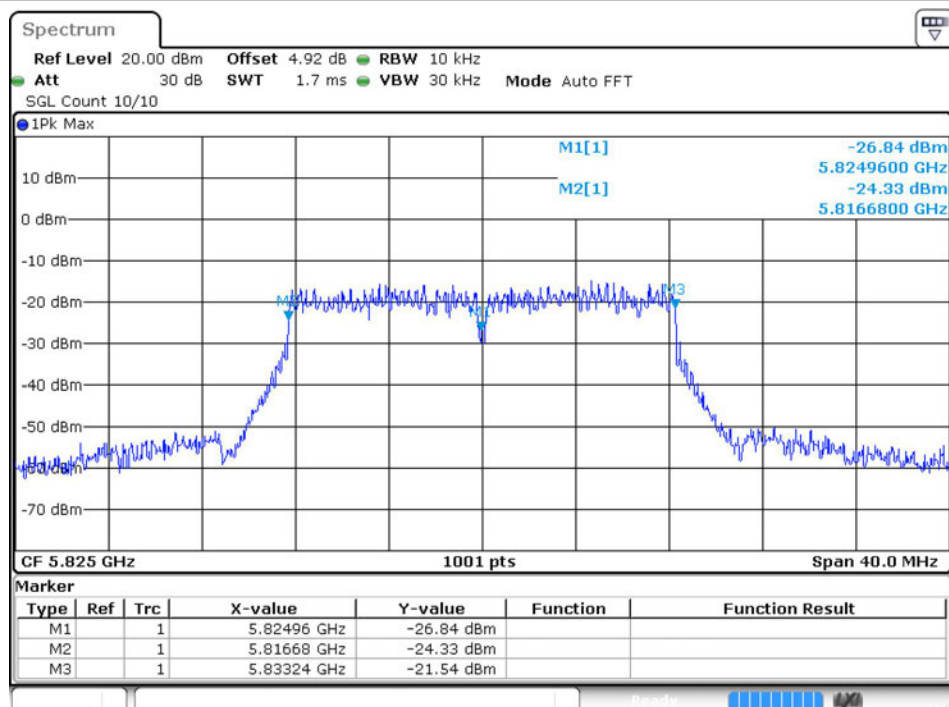




Freq. Stability 20C 102V n20 5745MHz Ant1

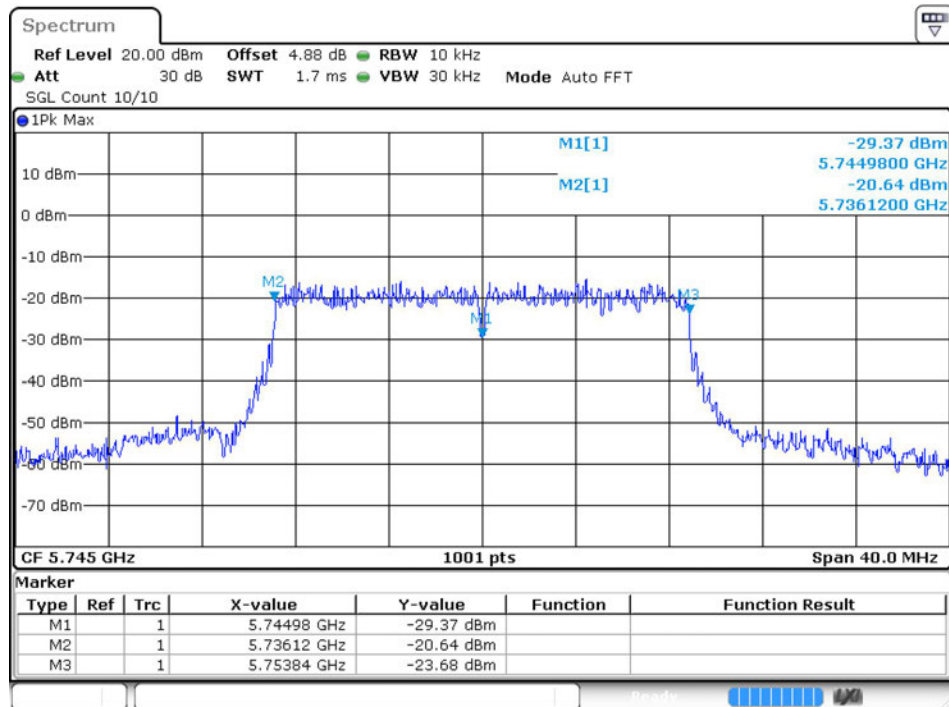


Freq. Stability 20C 120V n20 5745MHz Ant1

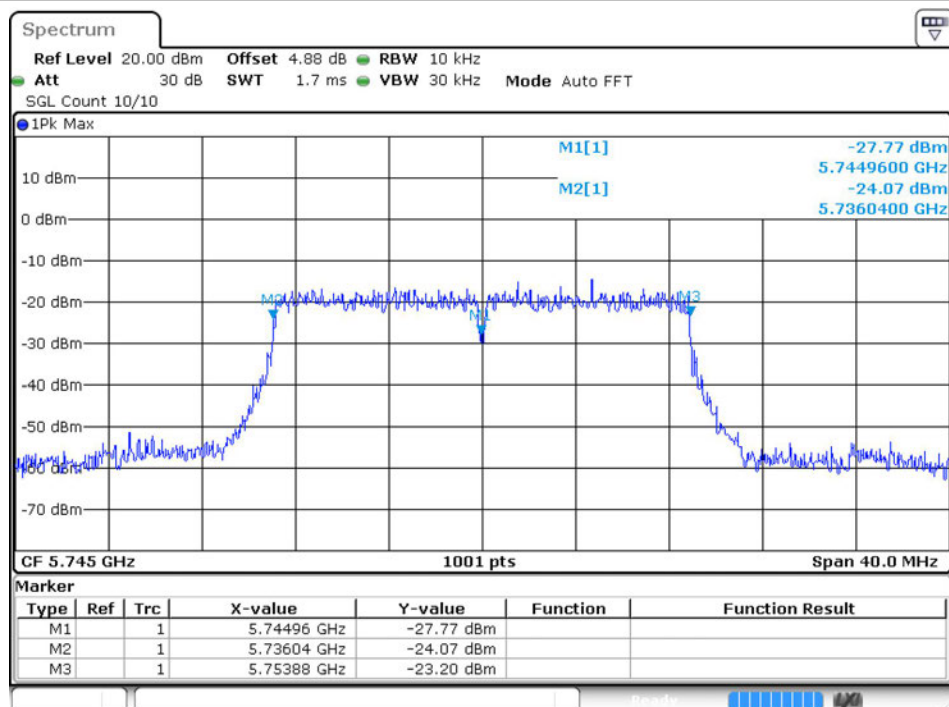




Freq. Stability 20C 138V n20 5745MHz Ant1

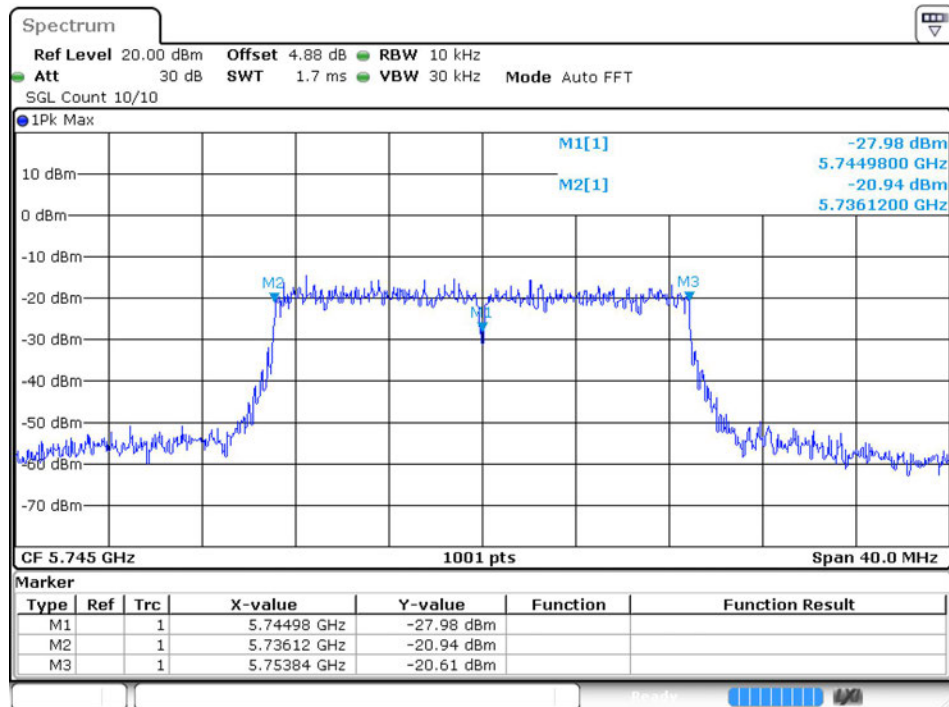


Freq. Stability -20C 120V n20 5745MHz Ant1

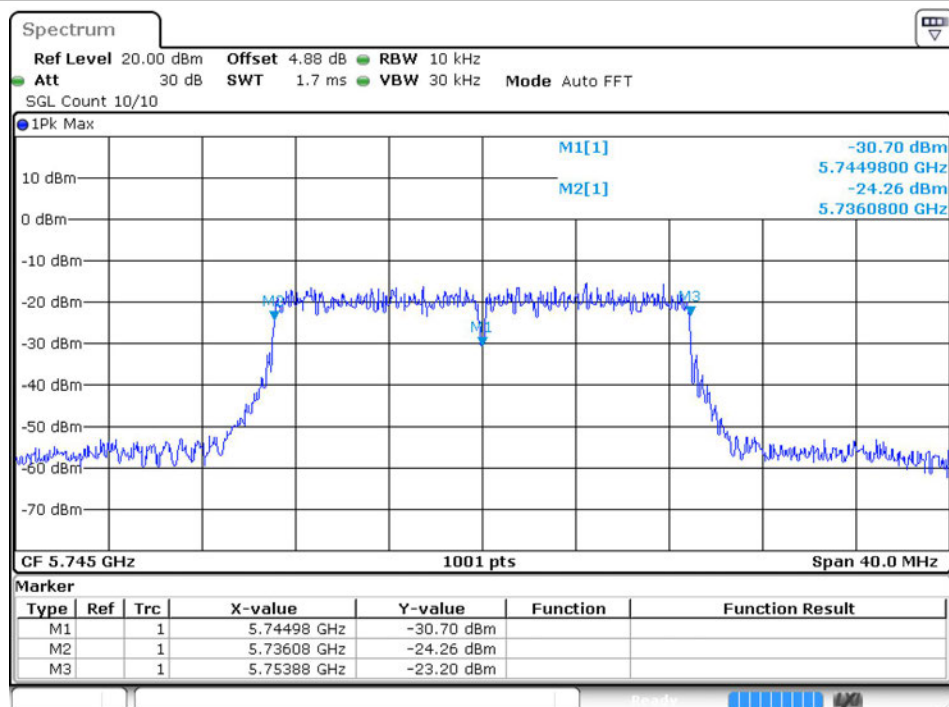




Freq. Stability -10C 120V n20 5745MHz Ant1

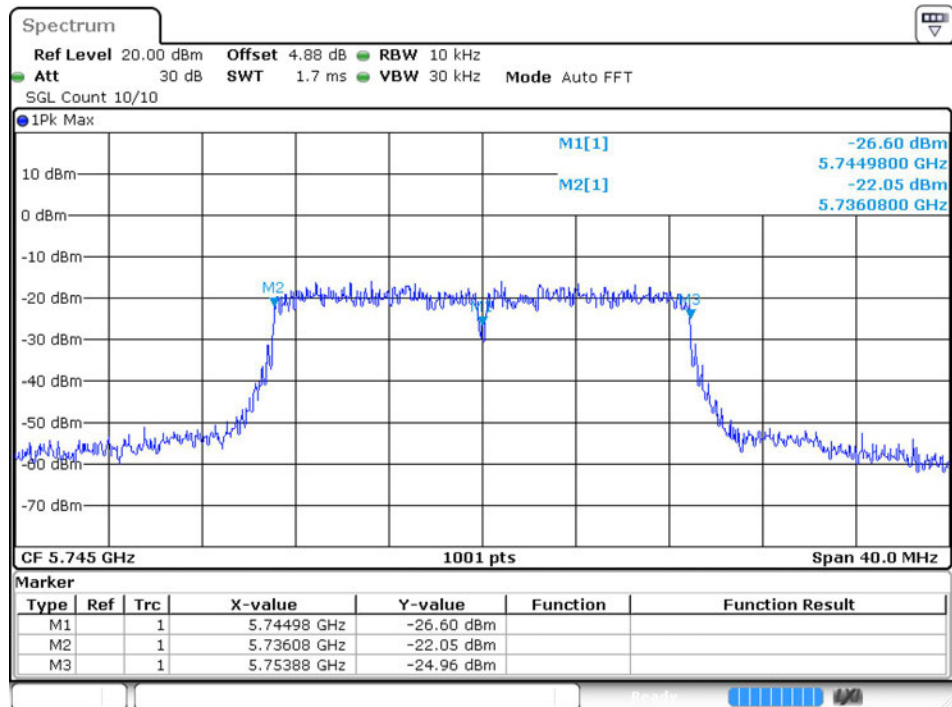


Freq. Stability 0C 120V n20 5745MHz Ant1

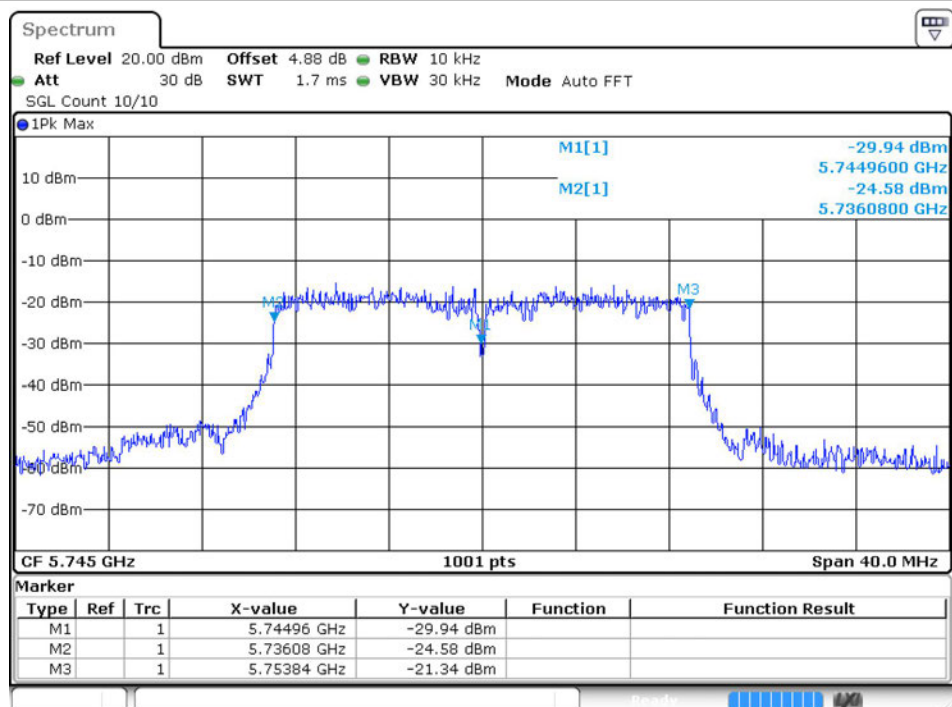




Freq. Stability 10C 120V n20 5745MHz Ant1

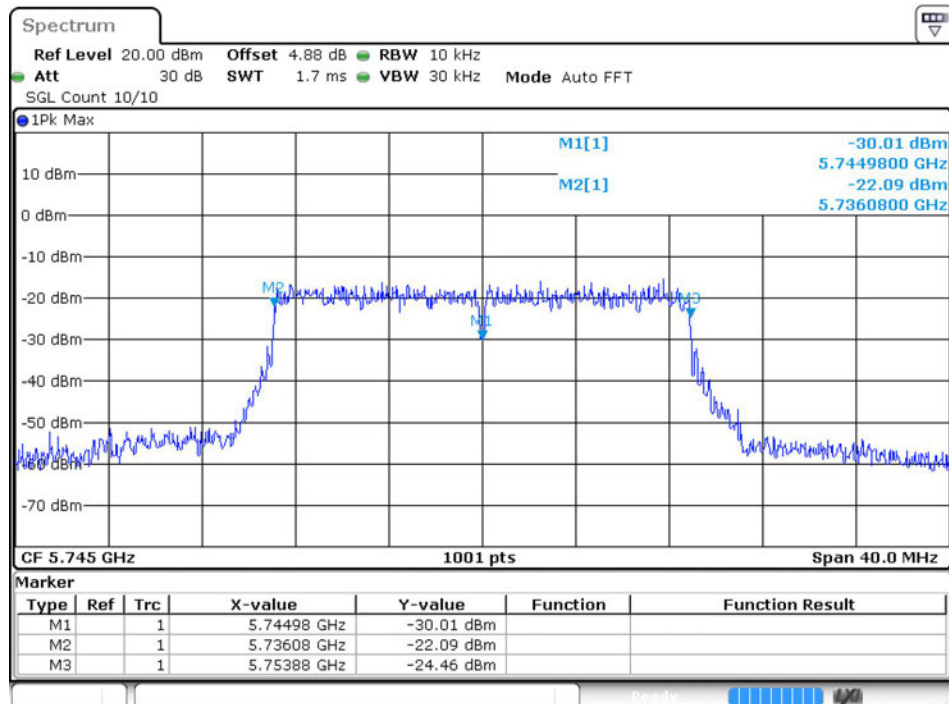


Freq. Stability 30C 120V n20 5745MHz Ant1

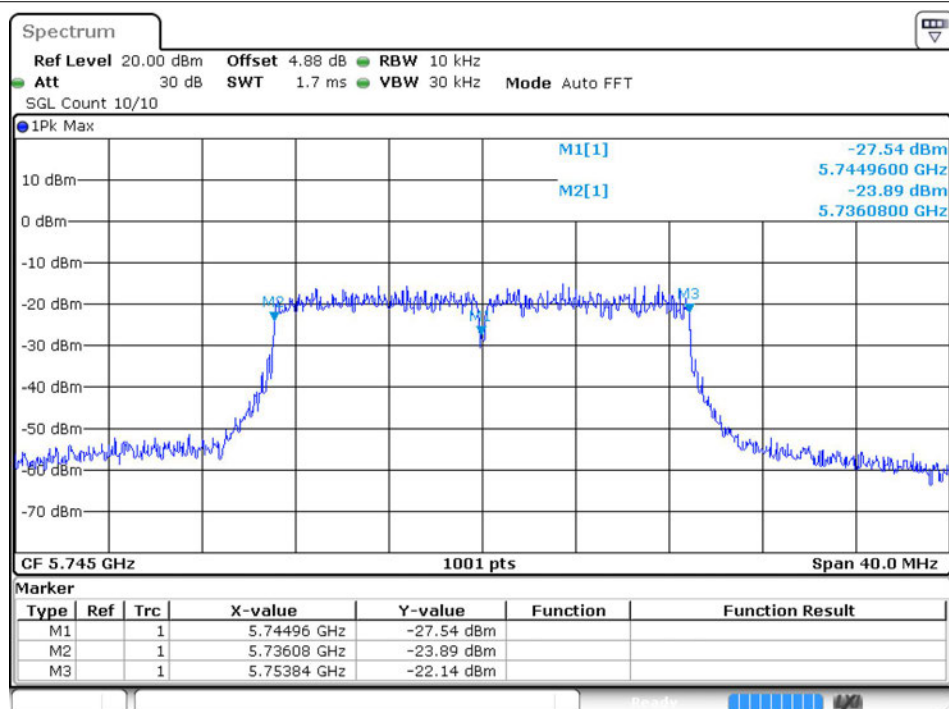




Freq. Stability 40C 120V n20 5745MHz Ant1

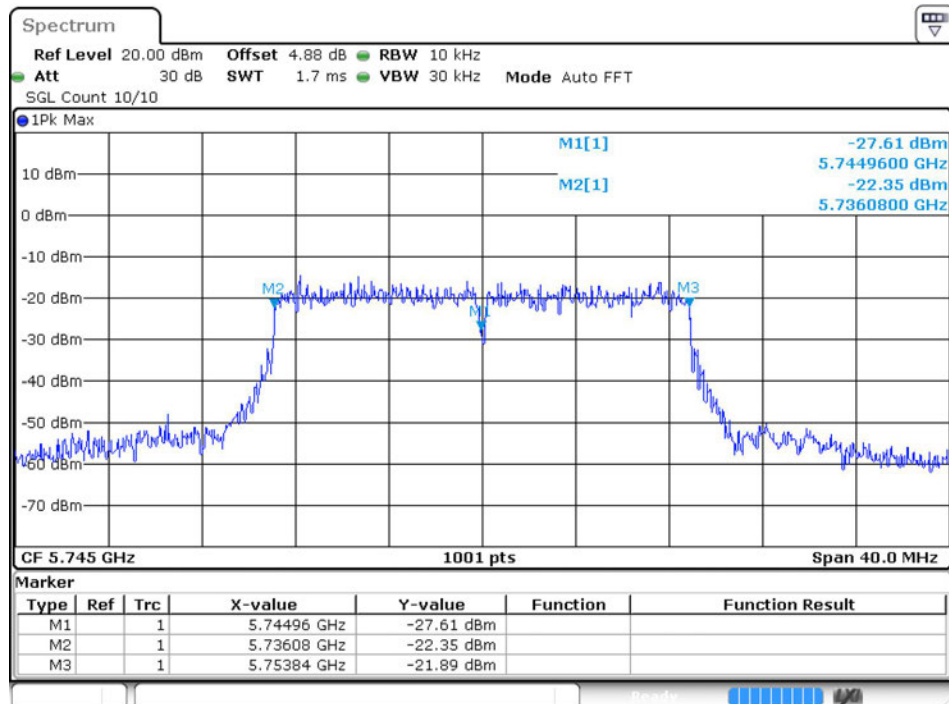


Freq. Stability 50C 120V n20 5745MHz Ant1

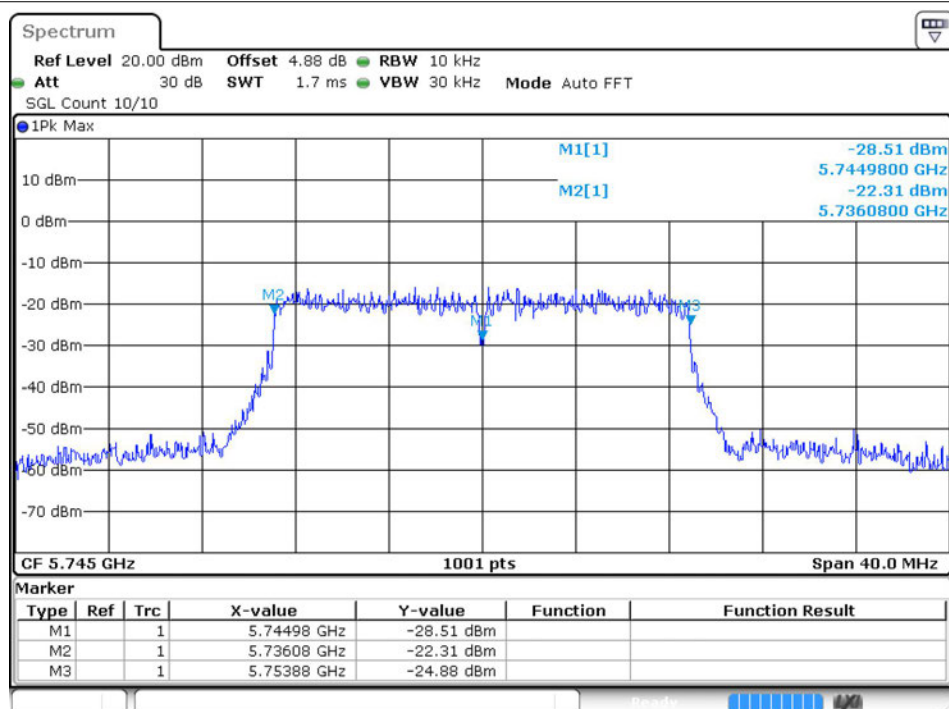




Freq. Stability 20C 102V n20 5785MHz Ant1

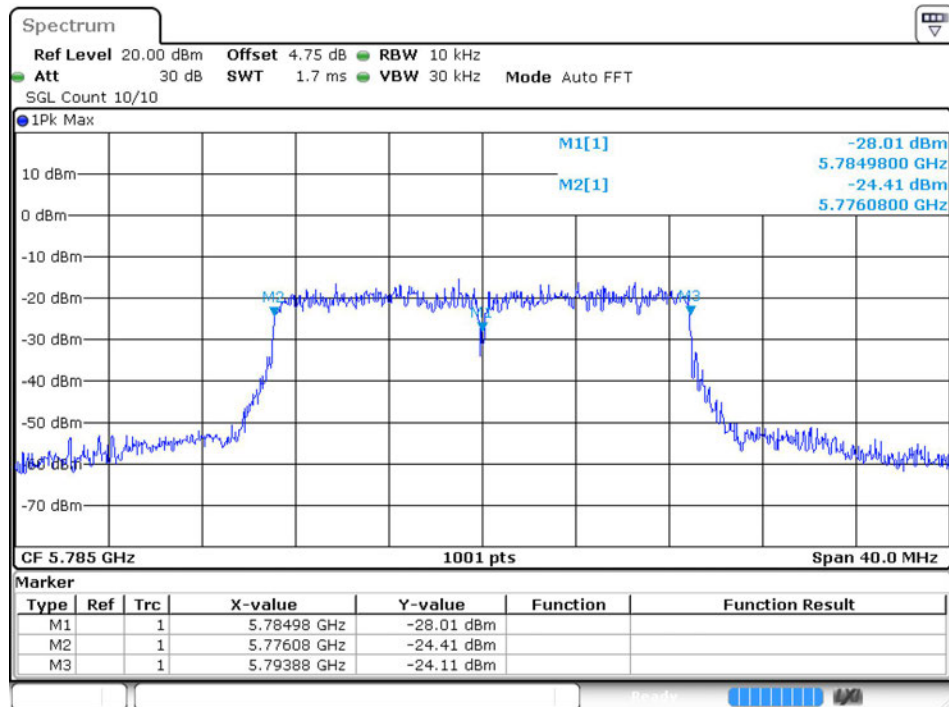


Freq. Stability 20C 120V n20 5785MHz Ant1

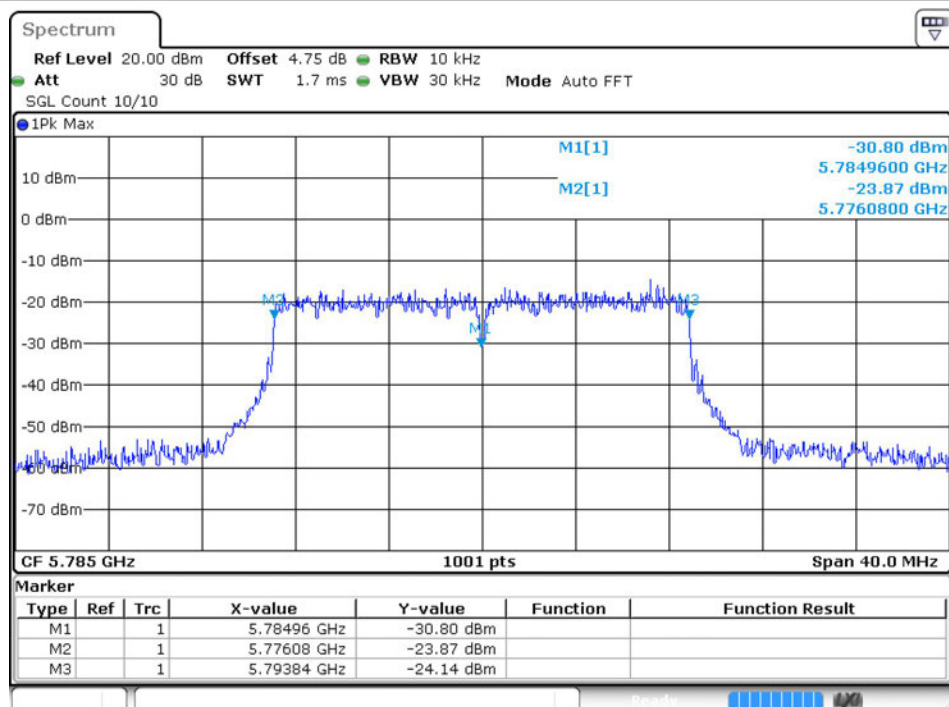




Freq. Stability 20C 138V n20 5785MHz Ant1

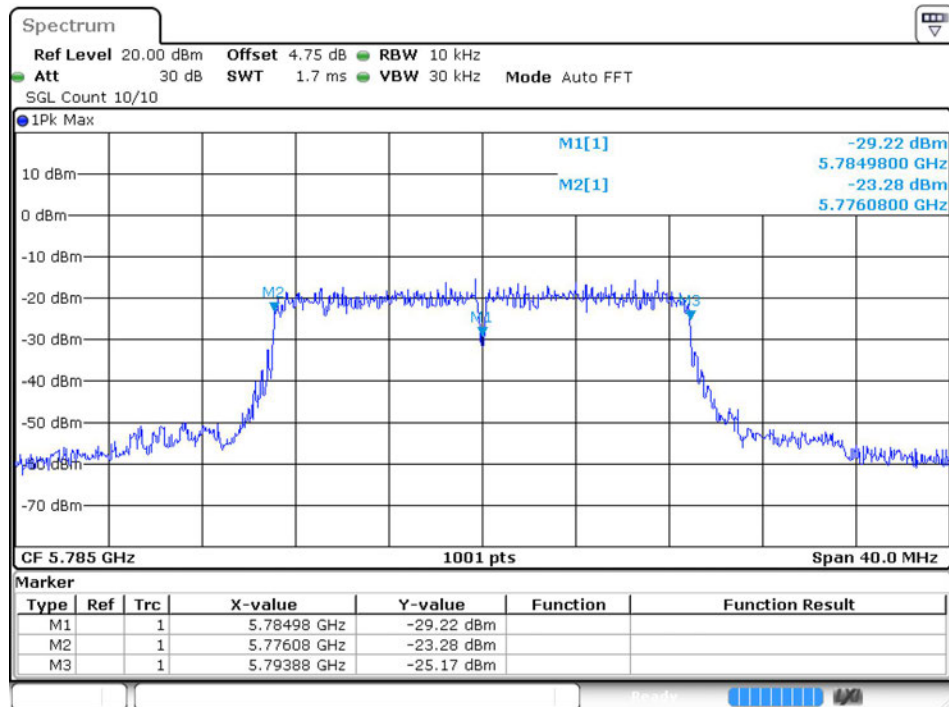


Freq. Stability -20C 120V n20 5785MHz Ant1

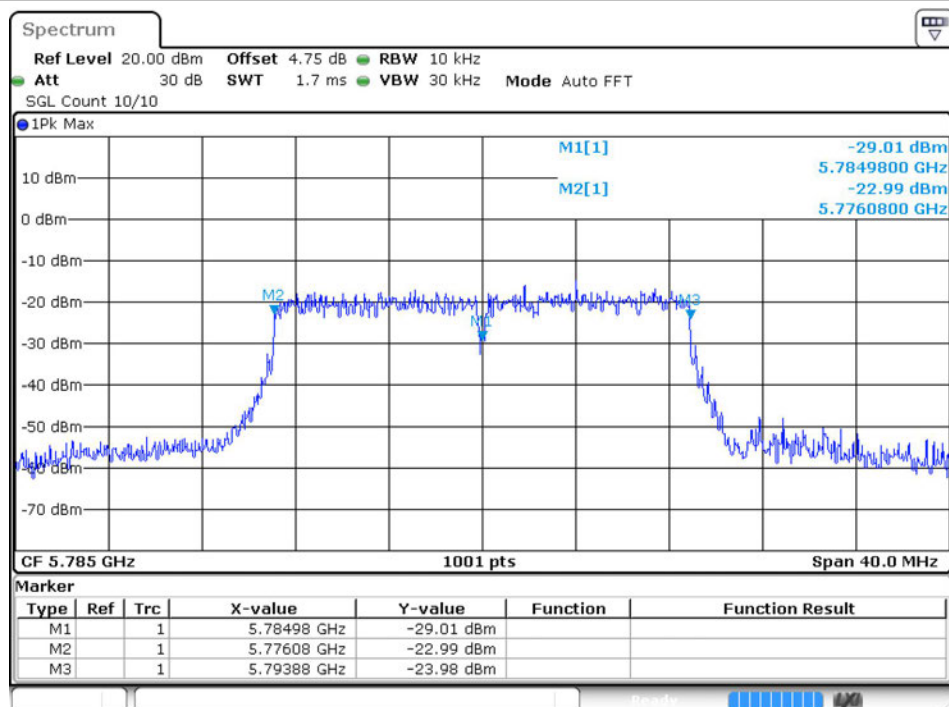




Freq. Stability -10C 120V n20 5785MHz Ant1

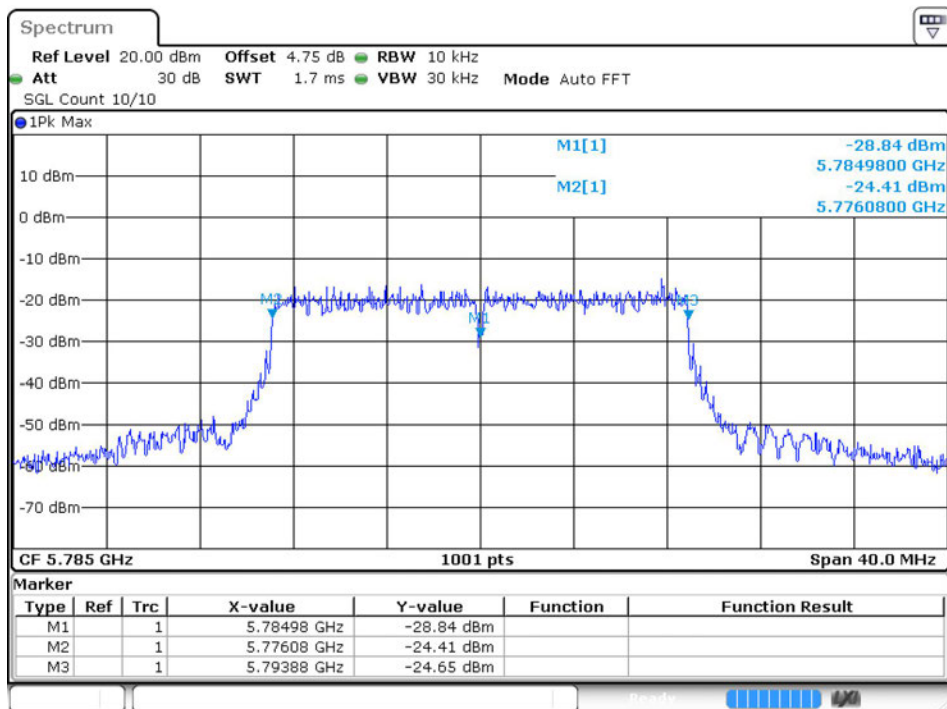


Freq. Stability 0C 120V n20 5785MHz Ant1

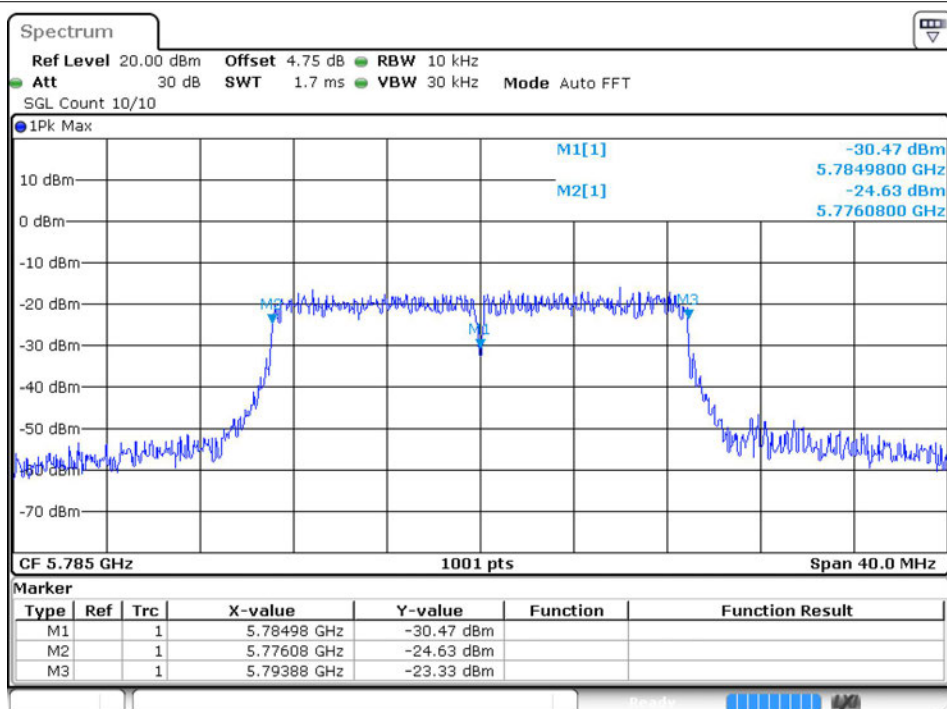




Freq. Stability 10C 120V n20 5785MHz Ant1

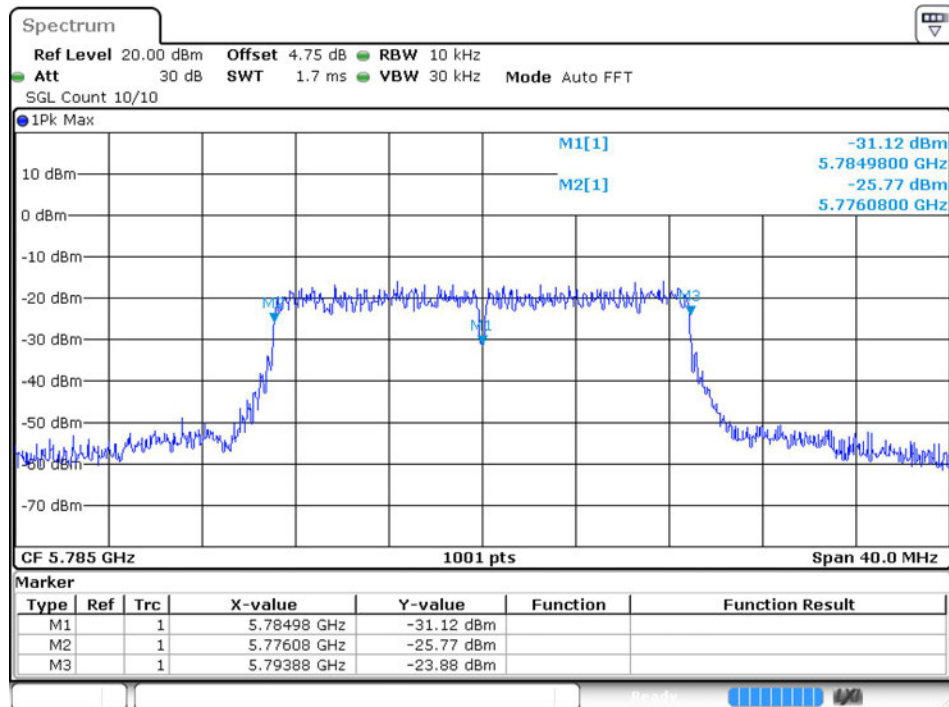


Freq. Stability 30C 120V n20 5785MHz Ant1

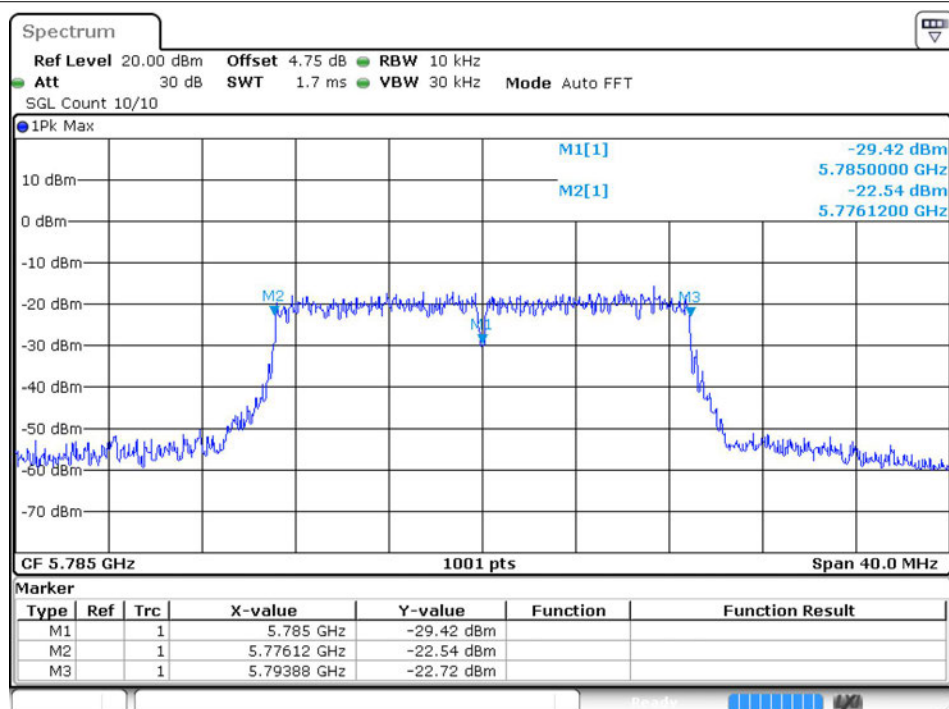




Freq. Stability 40C 120V n20 5785MHz Ant1

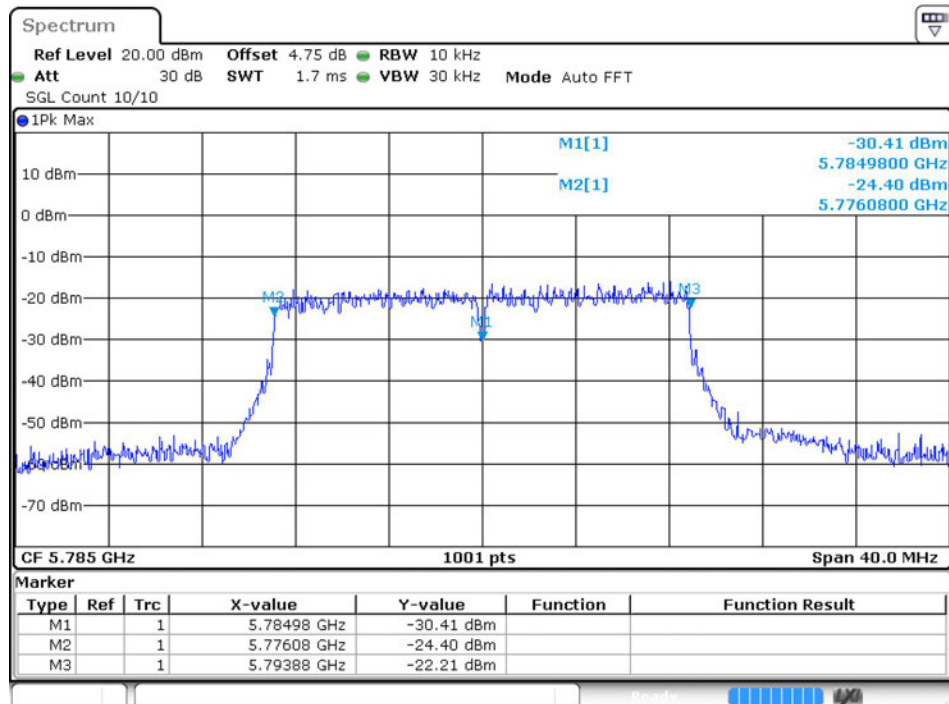


Freq. Stability 50C 120V n20 5785MHz Ant1

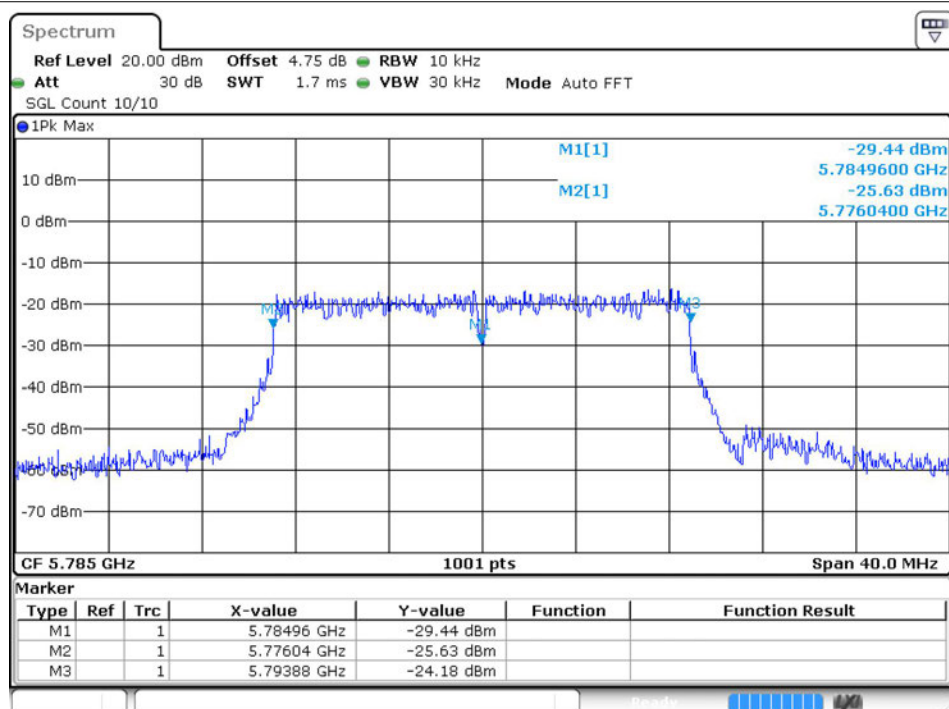




Freq. Stability 20C 102V n20 5825MHz Ant1

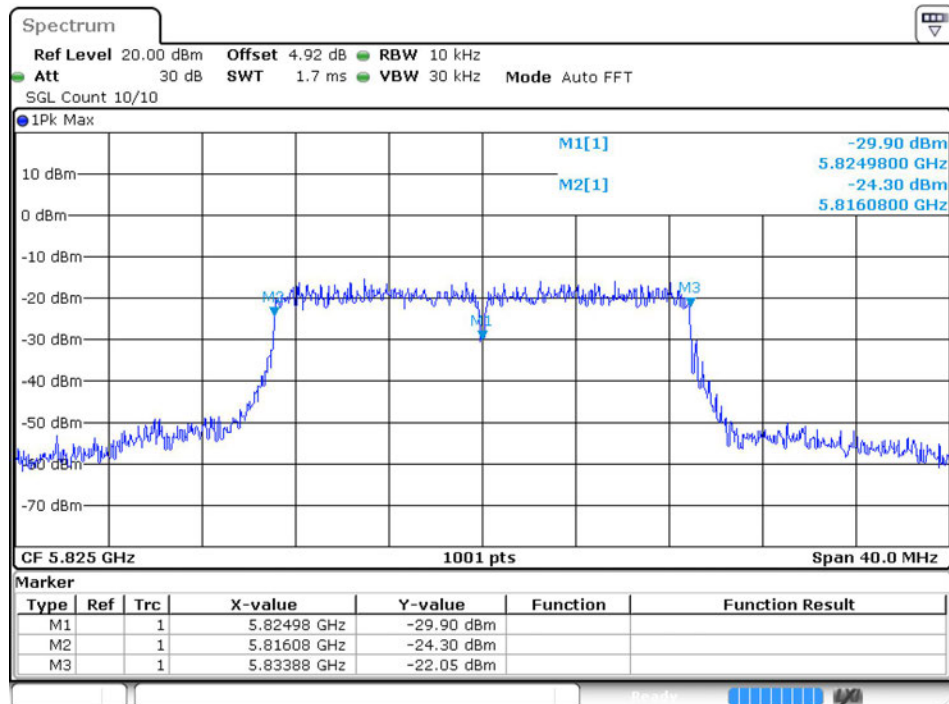


Freq. Stability 20C 120V n20 5825MHz Ant1

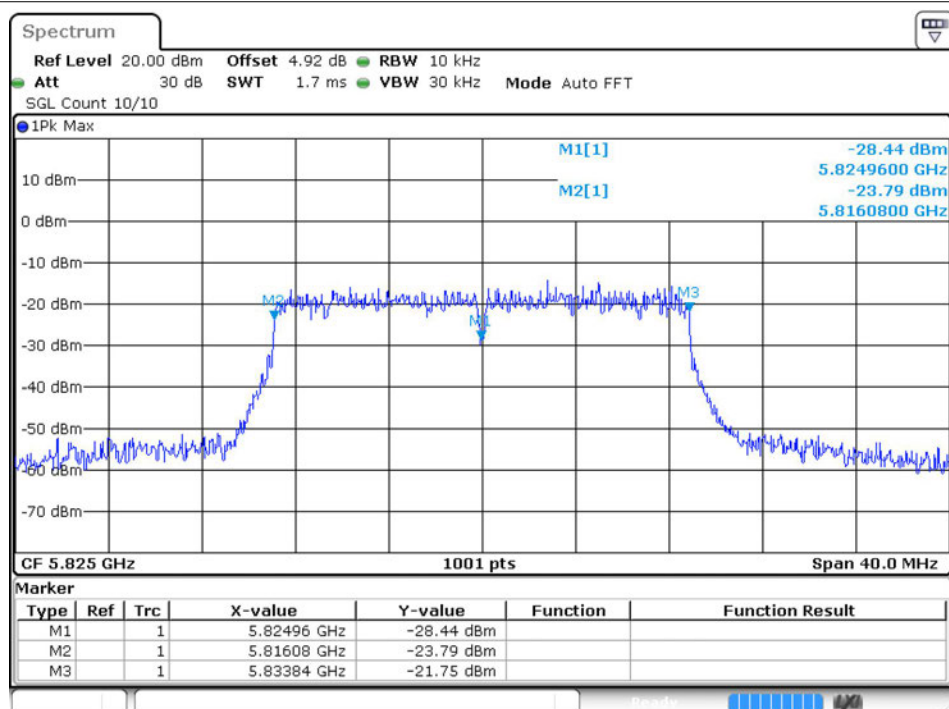



Freq. Stability 20C 138V n20 5825MHz Ant1

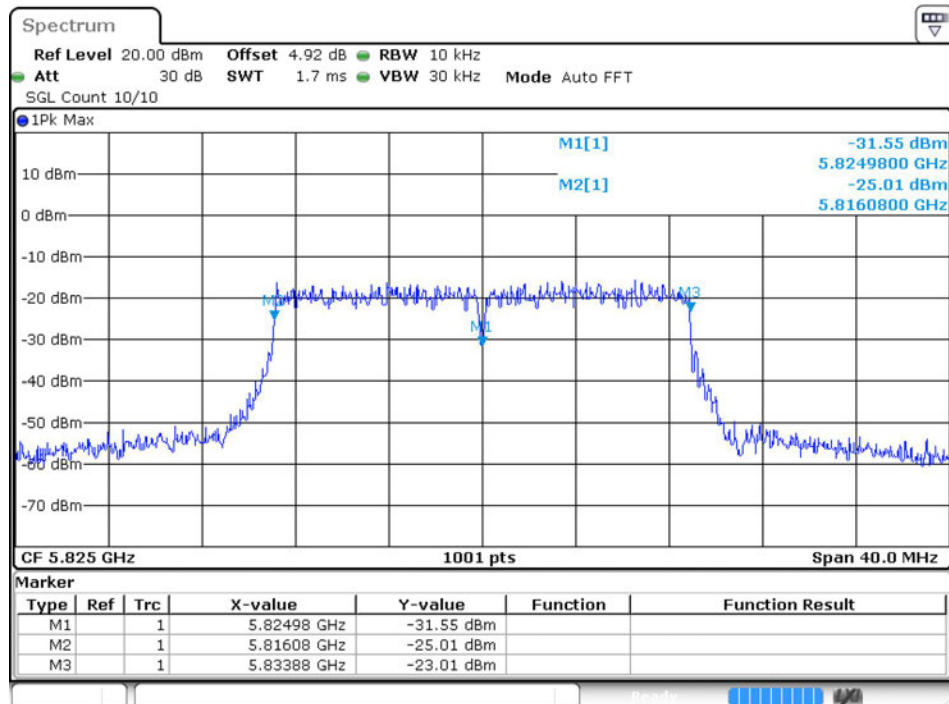

Freq. Stability -20C 120V n20 5825MHz Ant1

