


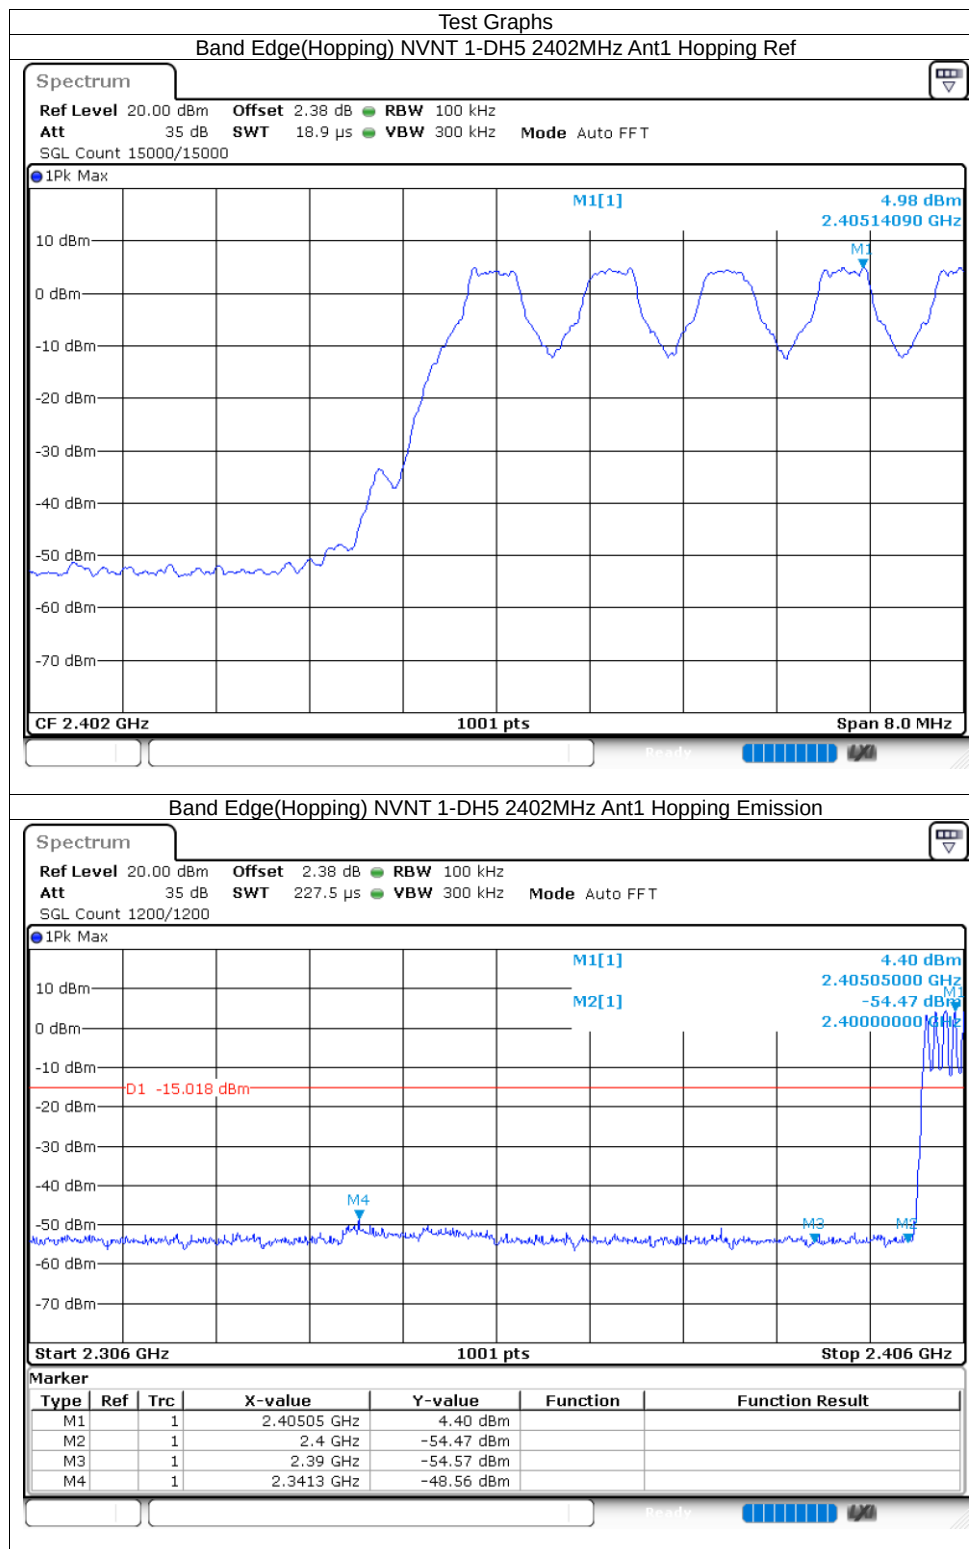
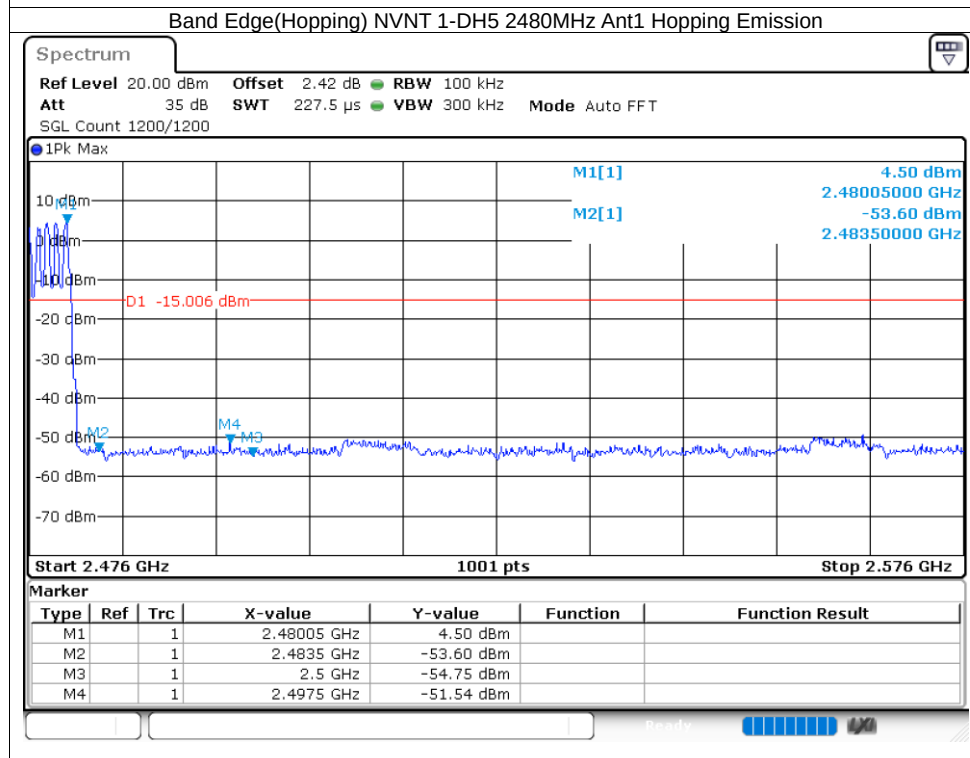




8.8 Band Edge(Hopping)



Condition	Mode	Frequency (MHz)	Antenna	Hopping Mode	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	1-DH5	2402	Ant1	Hopping	-53.53	-20	Pass
NVNT	1-DH5	2480	Ant1	Hopping	-56.53	-20	Pass
NVNT	2-DH5	2402	Ant1	Hopping	-55.56	-20	Pass
NVNT	2-DH5	2480	Ant1	Hopping	-58.07	-20	Pass
NVNT	3-DH5	2402	Ant1	Hopping	-56.43	-20	Pass
NVNT	3-DH5	2480	Ant1	Hopping	-57.94	-20	Pass


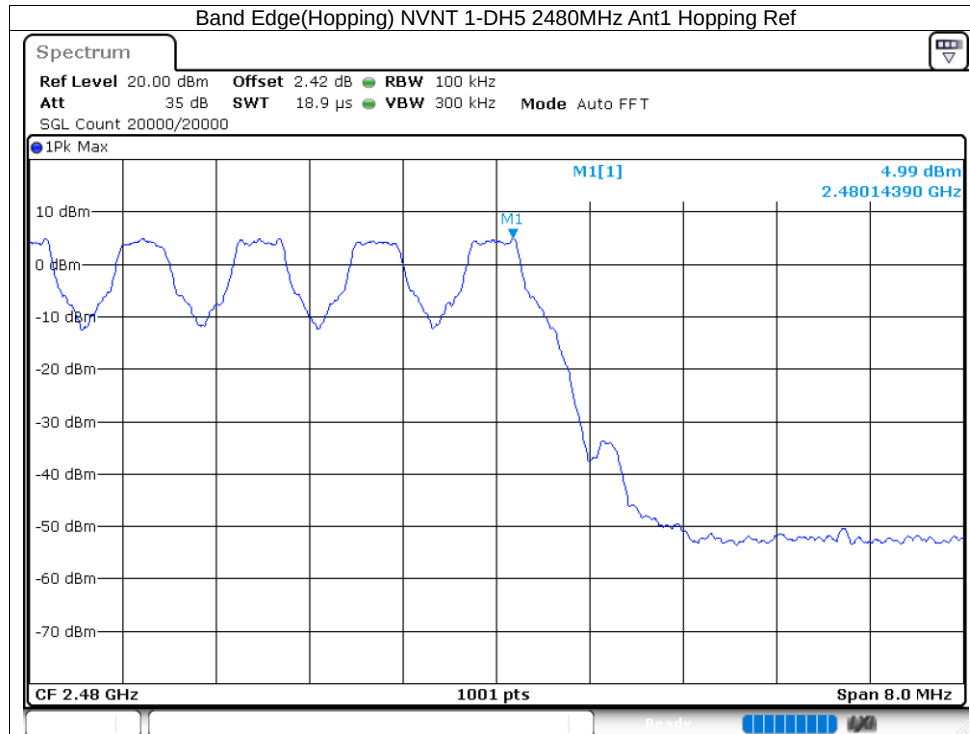


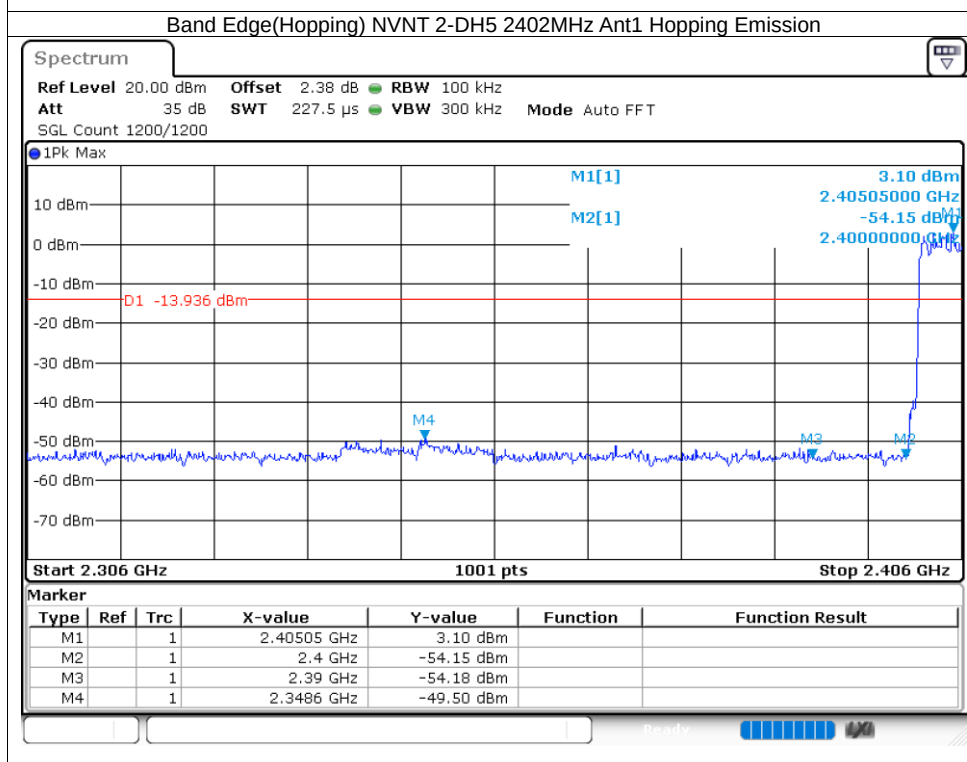

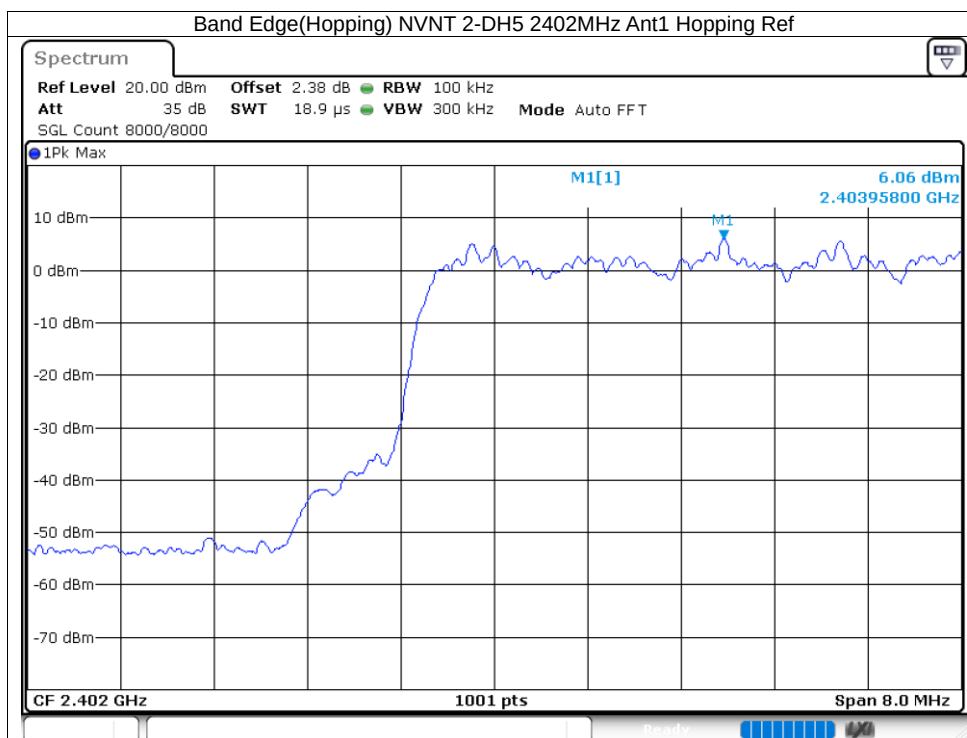

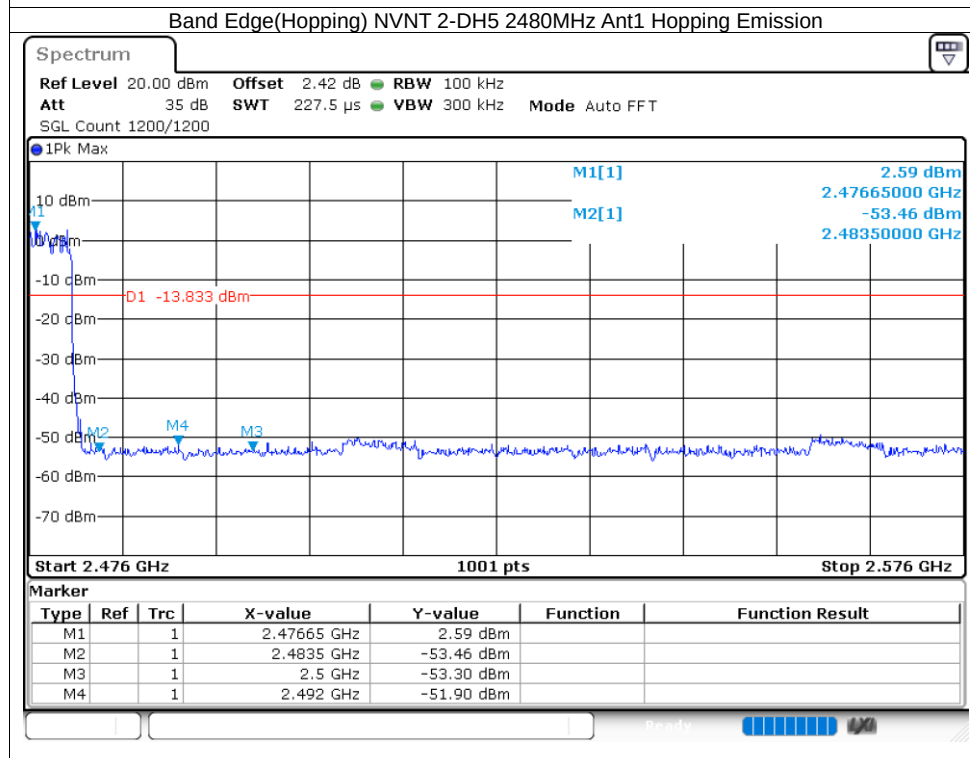
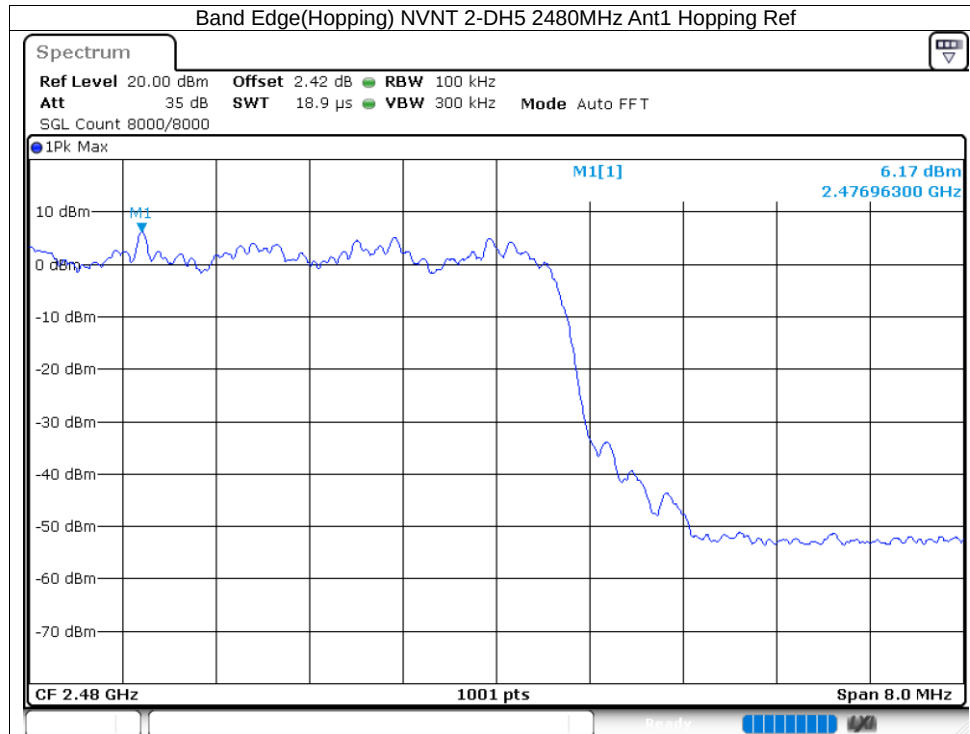


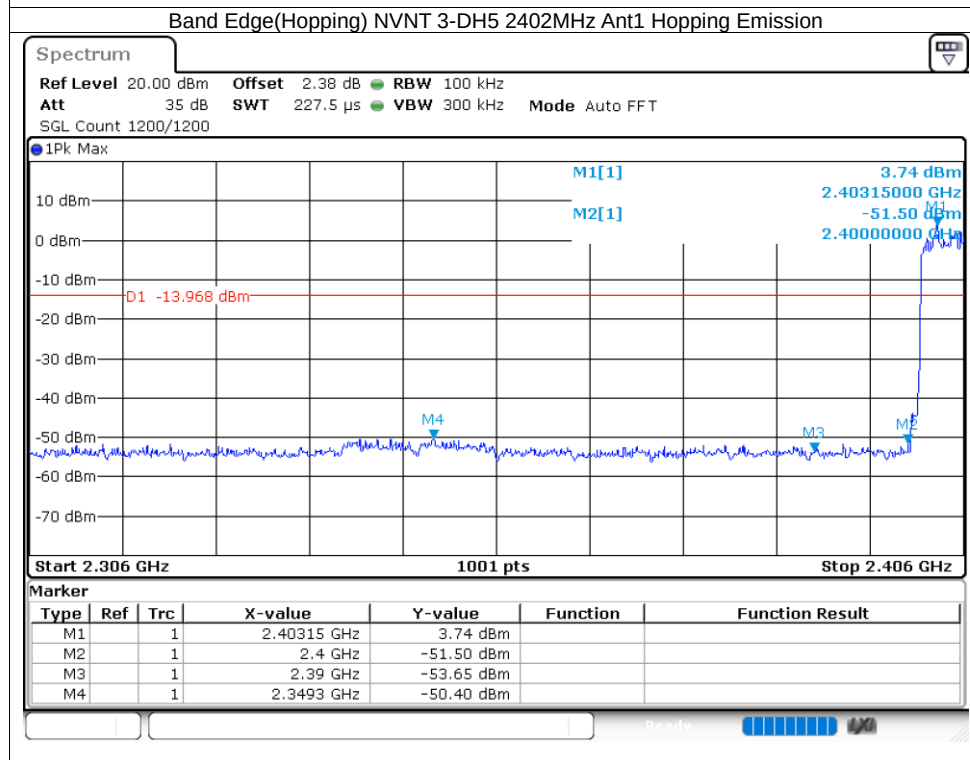
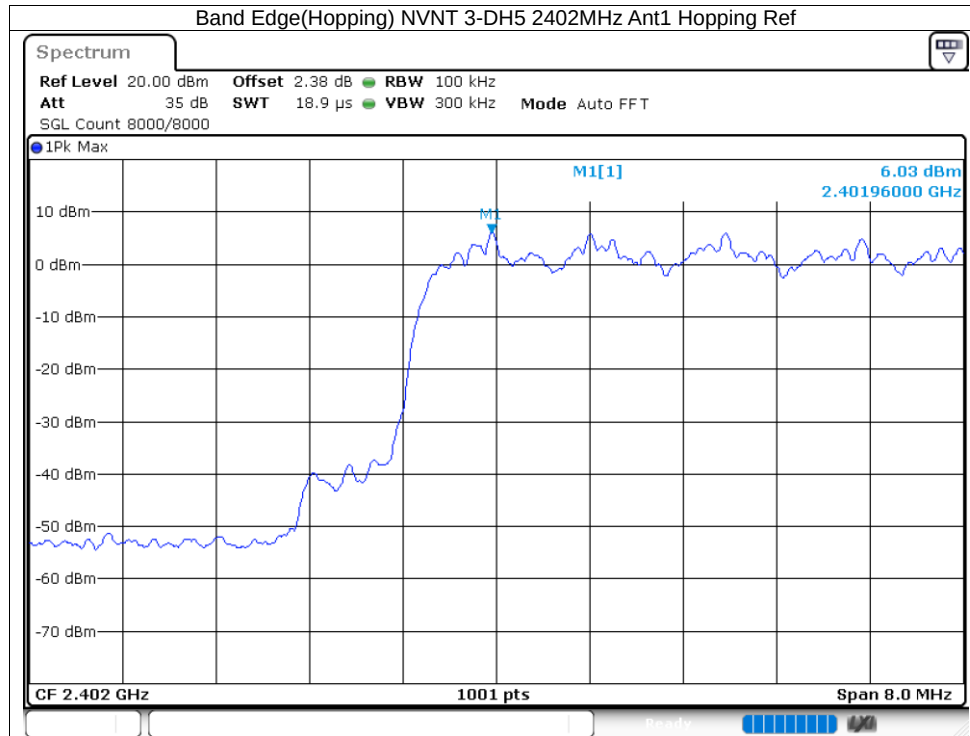


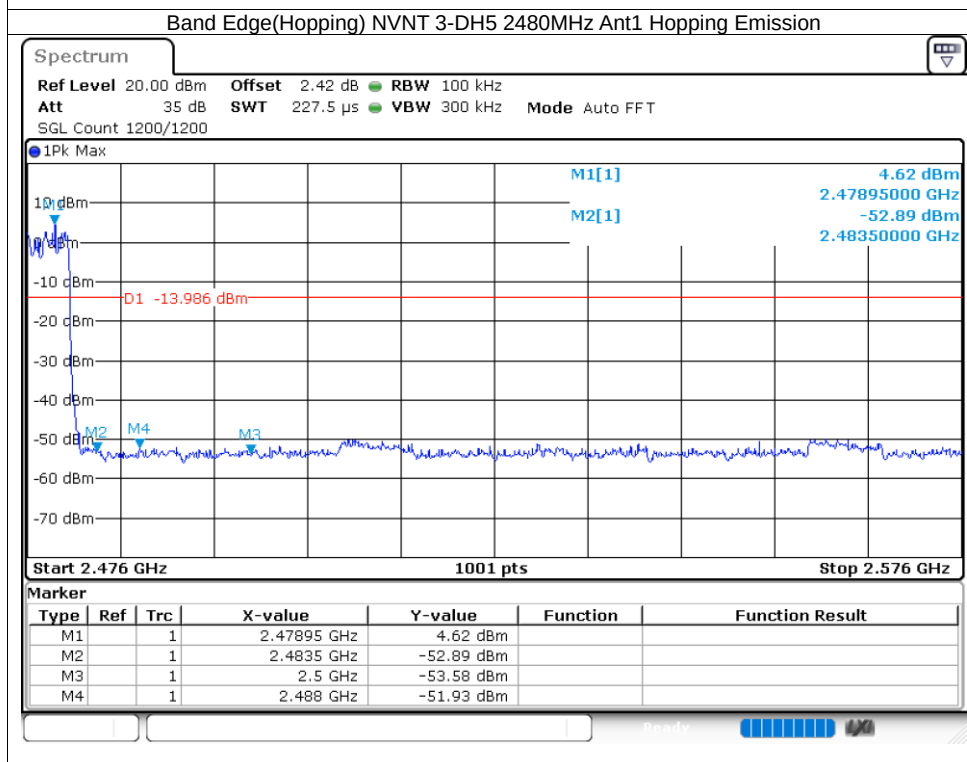
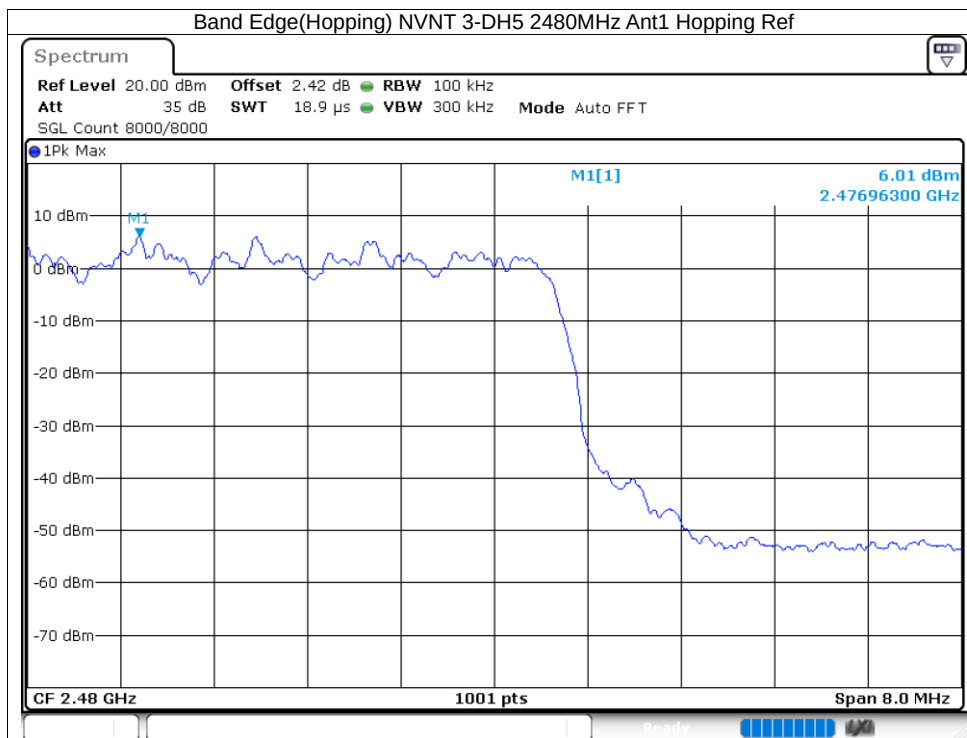




8.9 Conducted RF Spurious Emission



Condition	Mode	Frequency (MHz)	Antenna	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	1-DH5	2402	Ant1	-55.34	-20	Pass
NVNT	1-DH5	2441	Ant1	-55.78	-20	Pass
NVNT	1-DH5	2480	Ant1	-55.68	-20	Pass
NVNT	2-DH5	2402	Ant1	-54.1	-20	Pass
NVNT	2-DH5	2441	Ant1	-49.3	-20	Pass
NVNT	2-DH5	2480	Ant1	-53.49	-20	Pass
NVNT	3-DH5	2402	Ant1	-46.06	-20	Pass
NVNT	3-DH5	2441	Ant1	-54.55	-20	Pass
NVNT	3-DH5	2480	Ant1	-53.97	-20	Pass

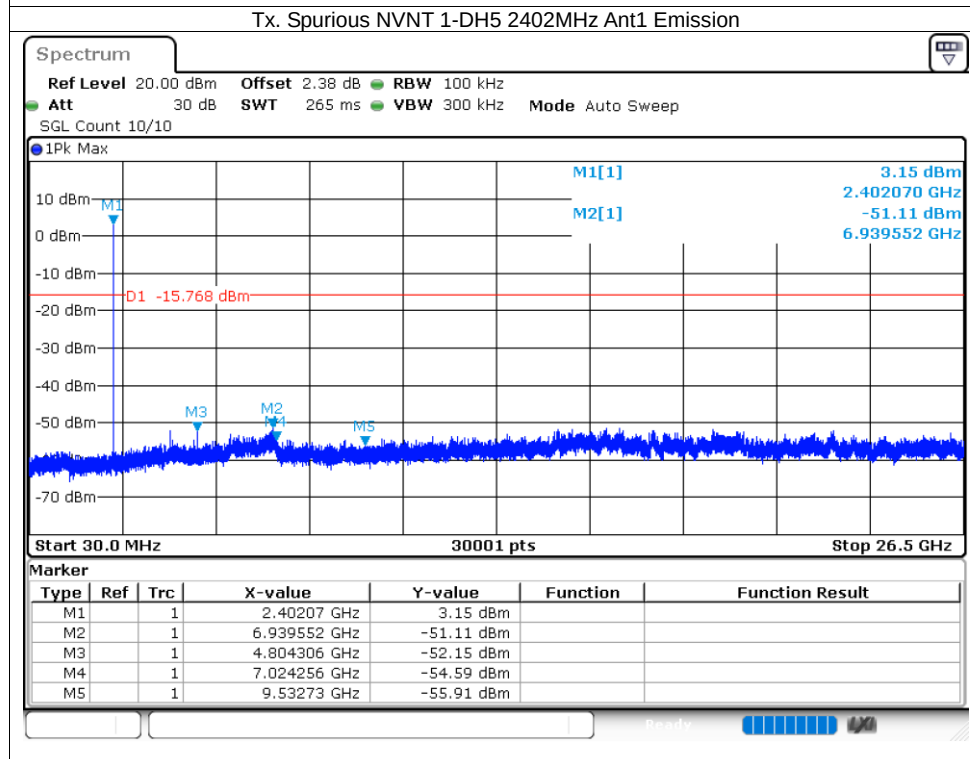
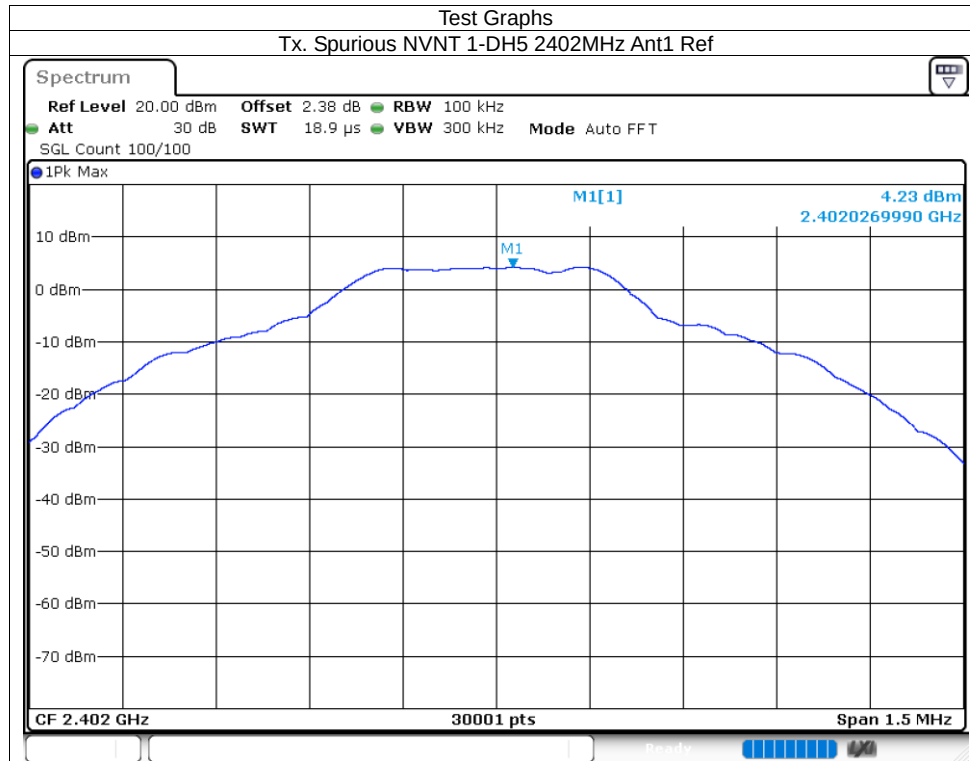


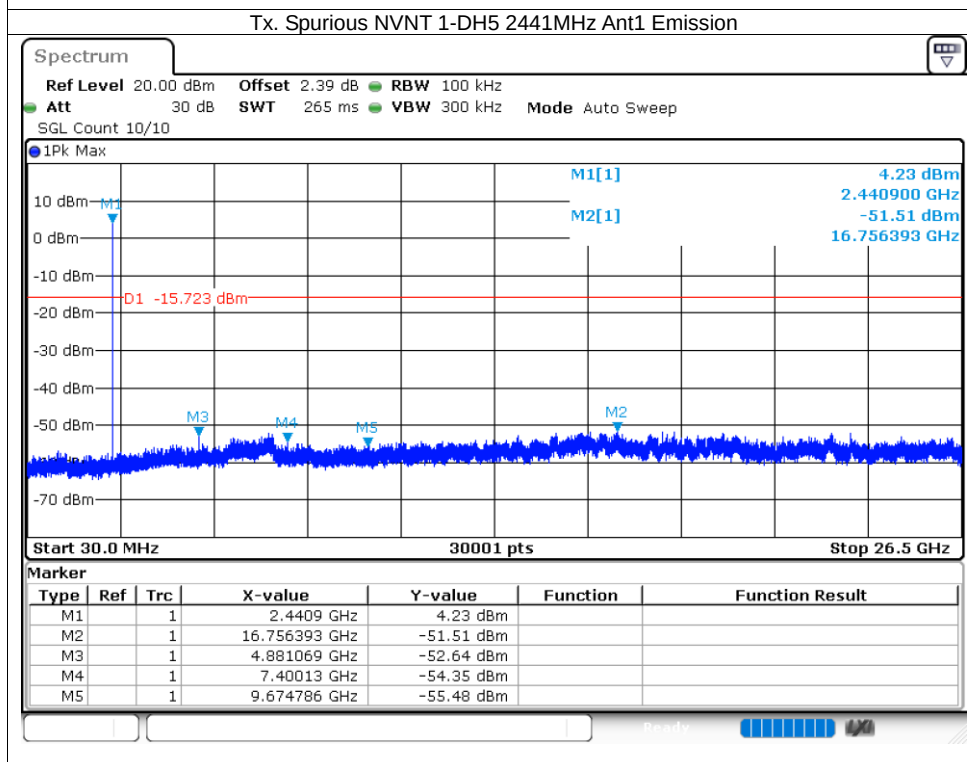
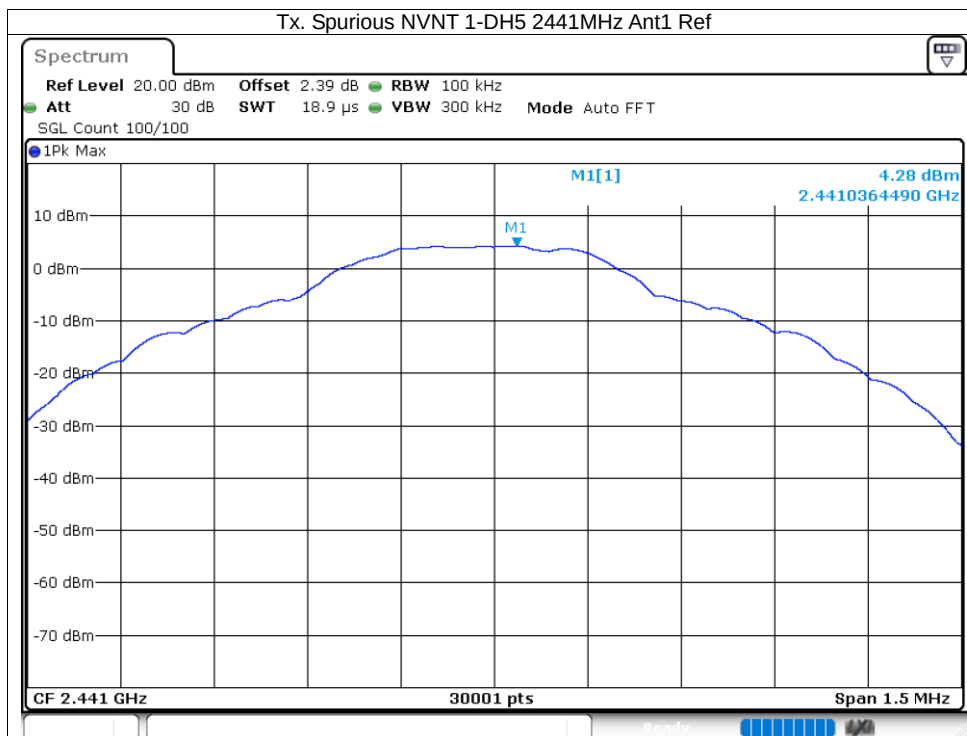


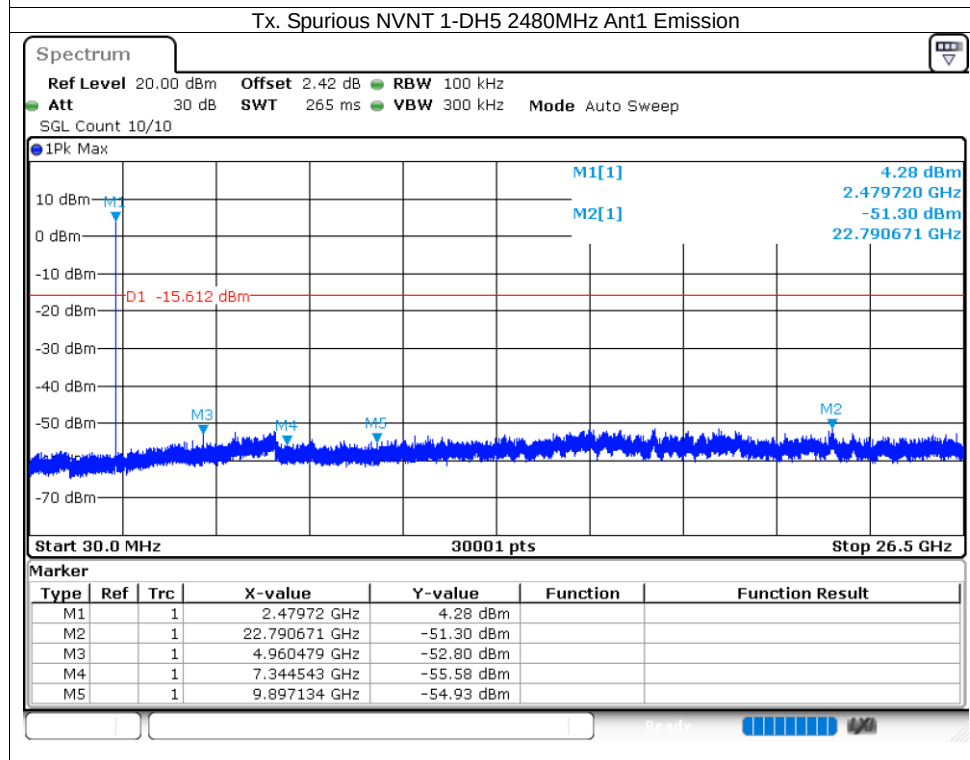
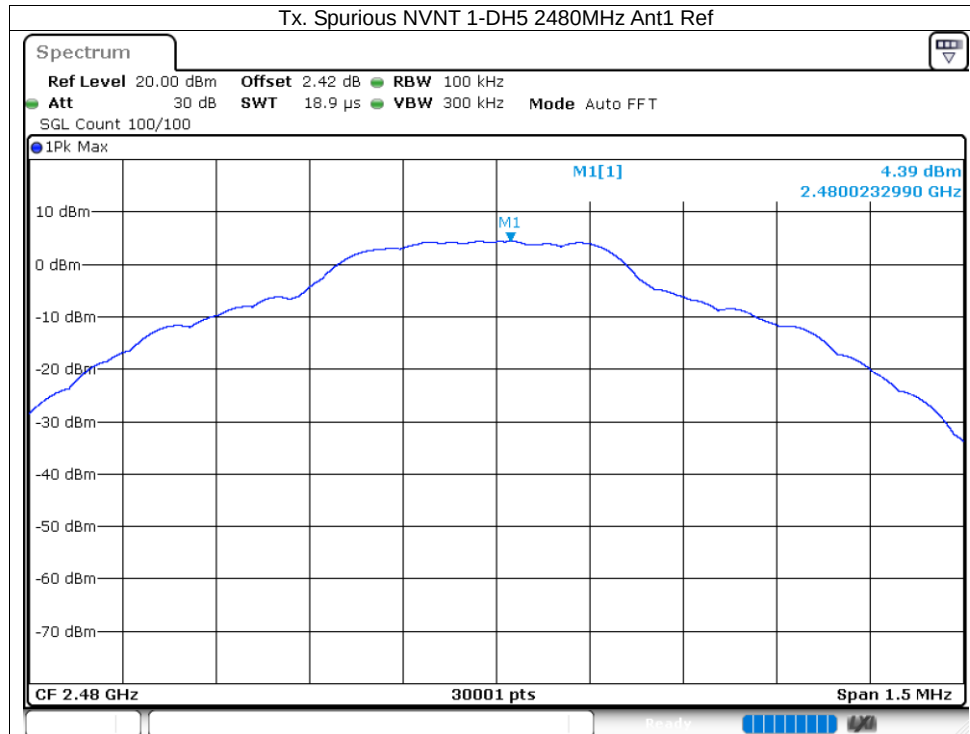


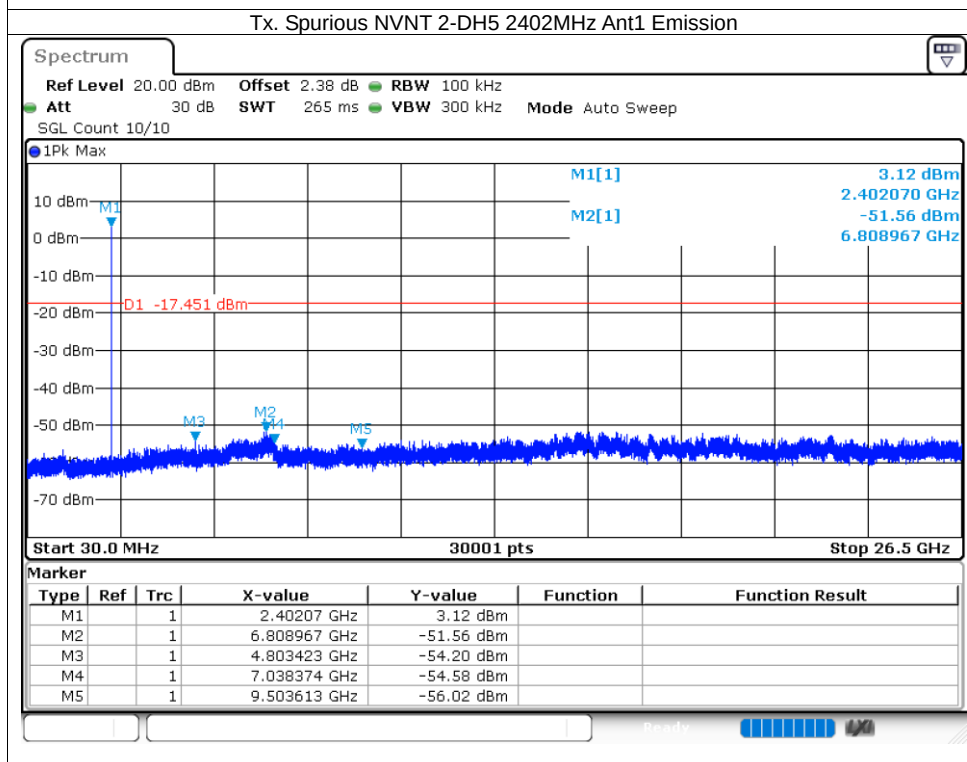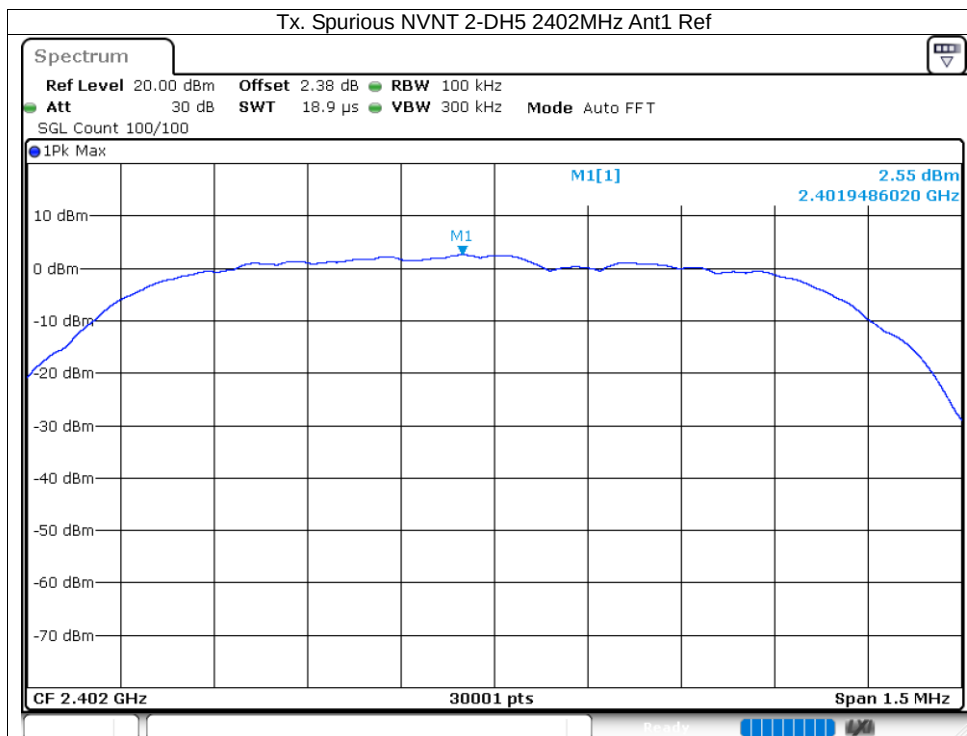


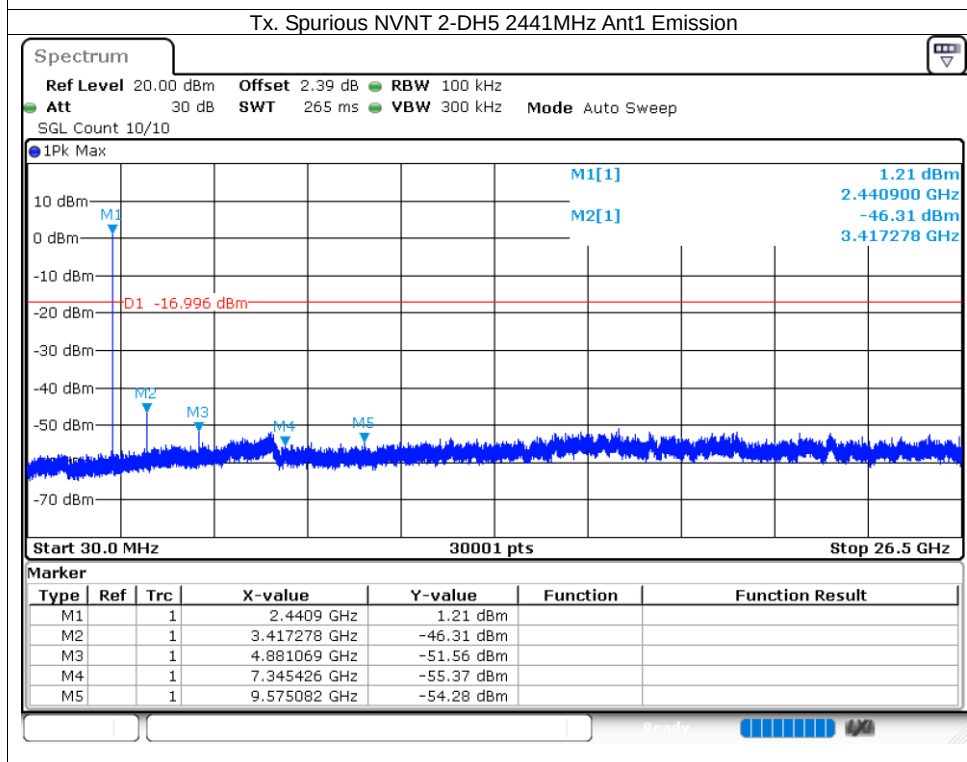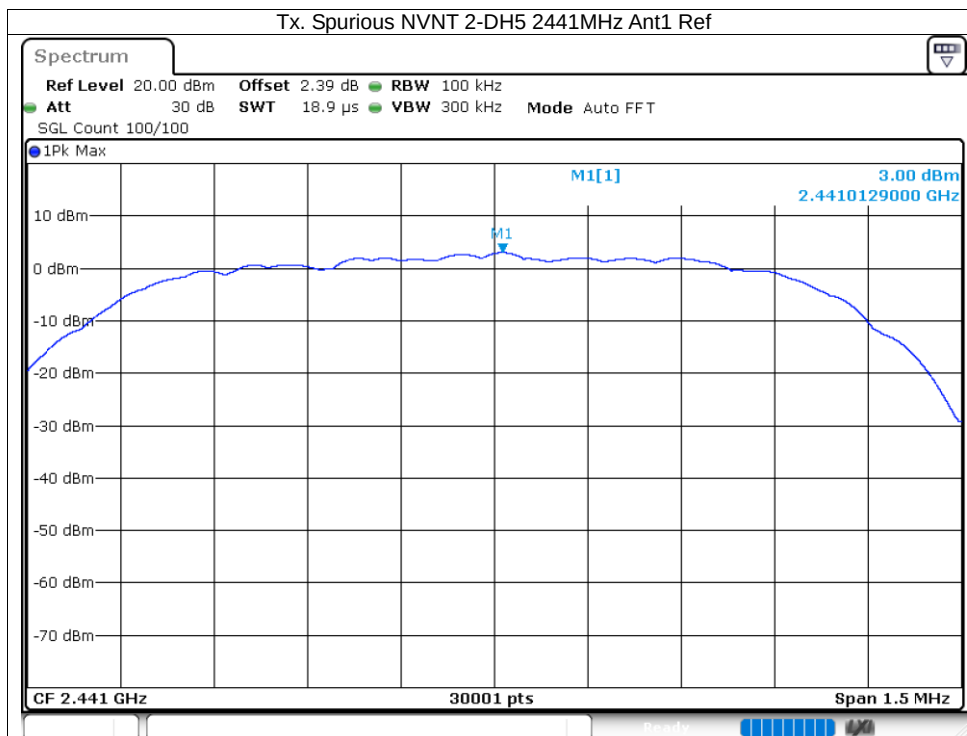

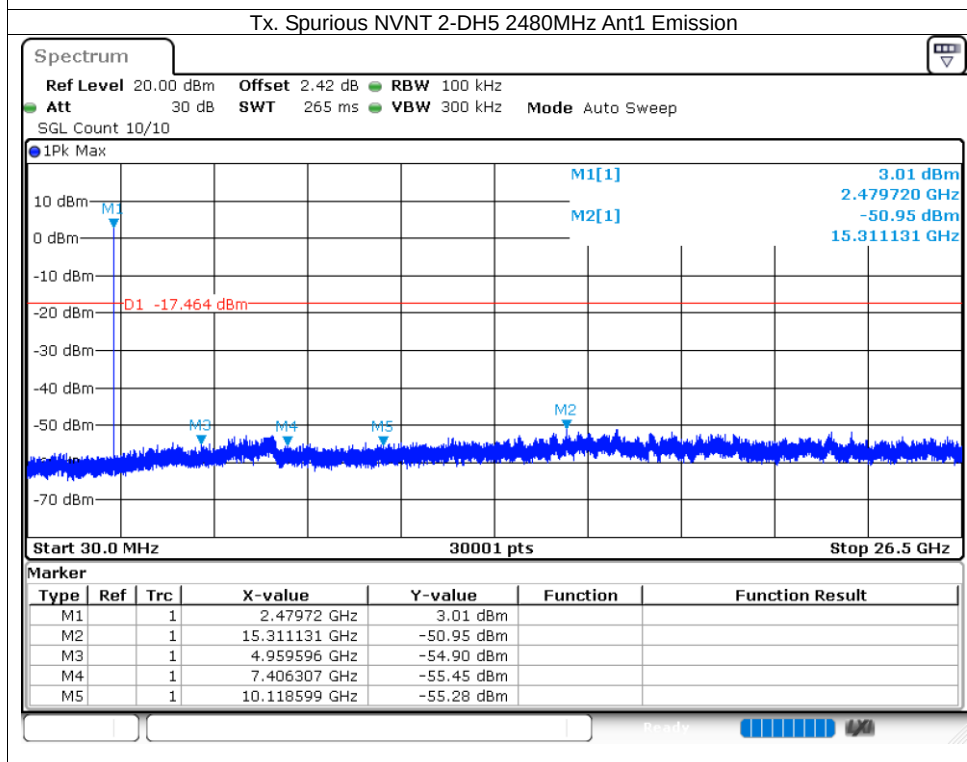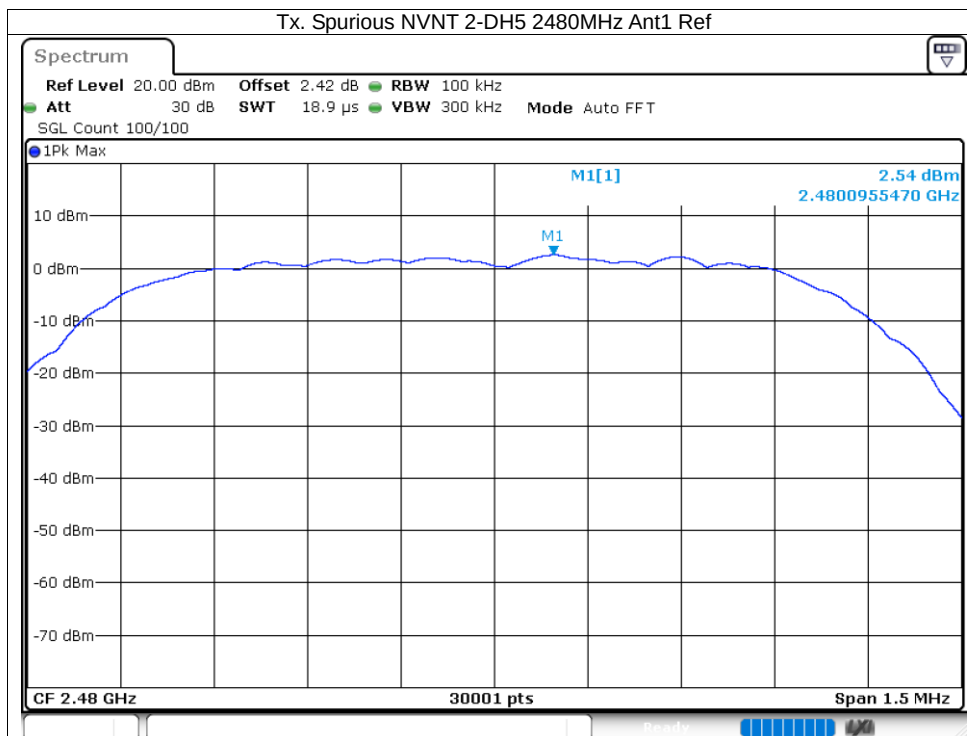

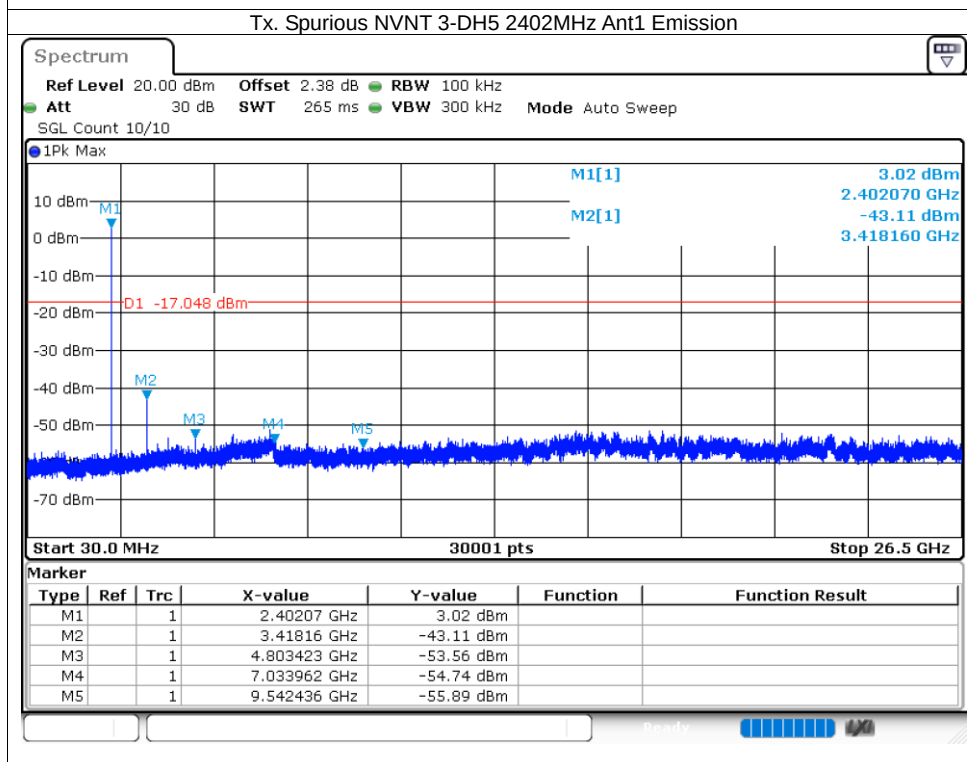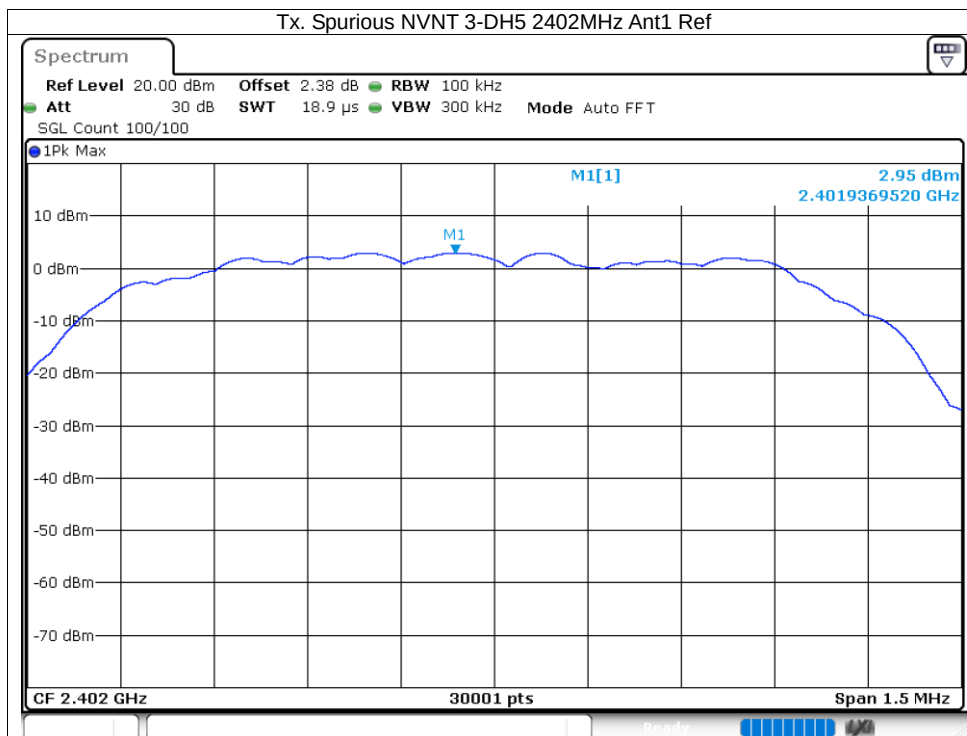

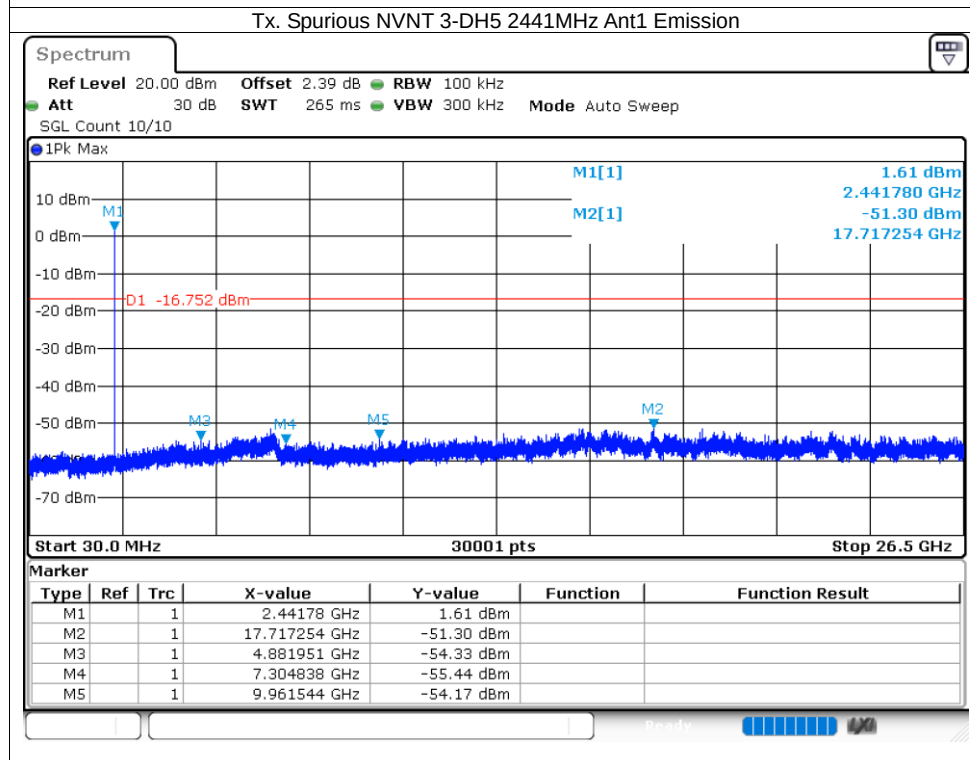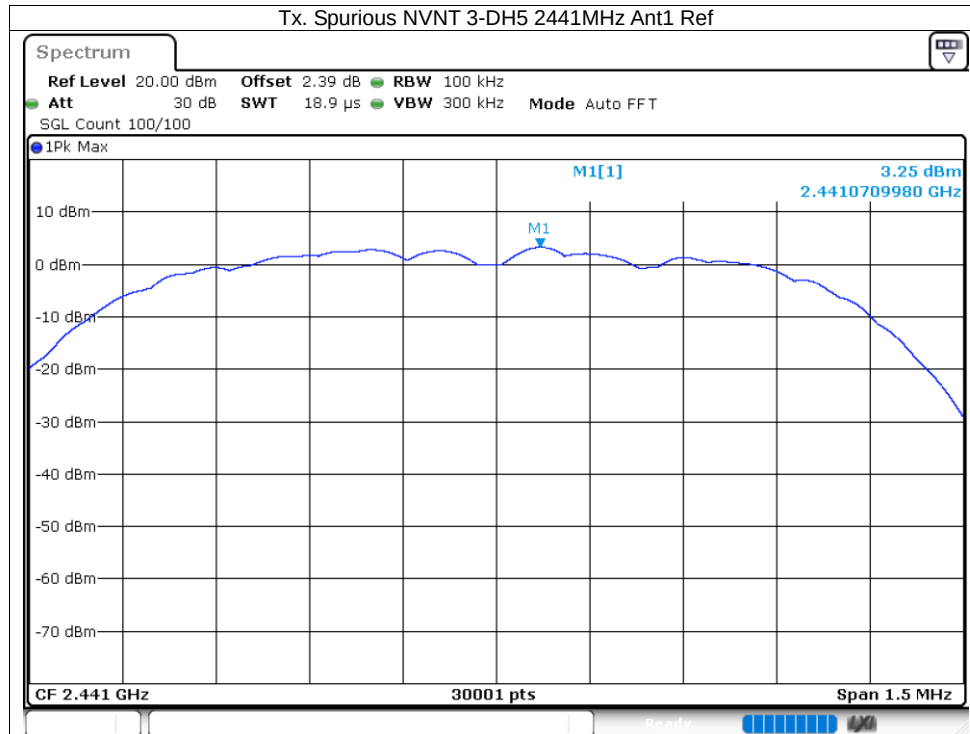

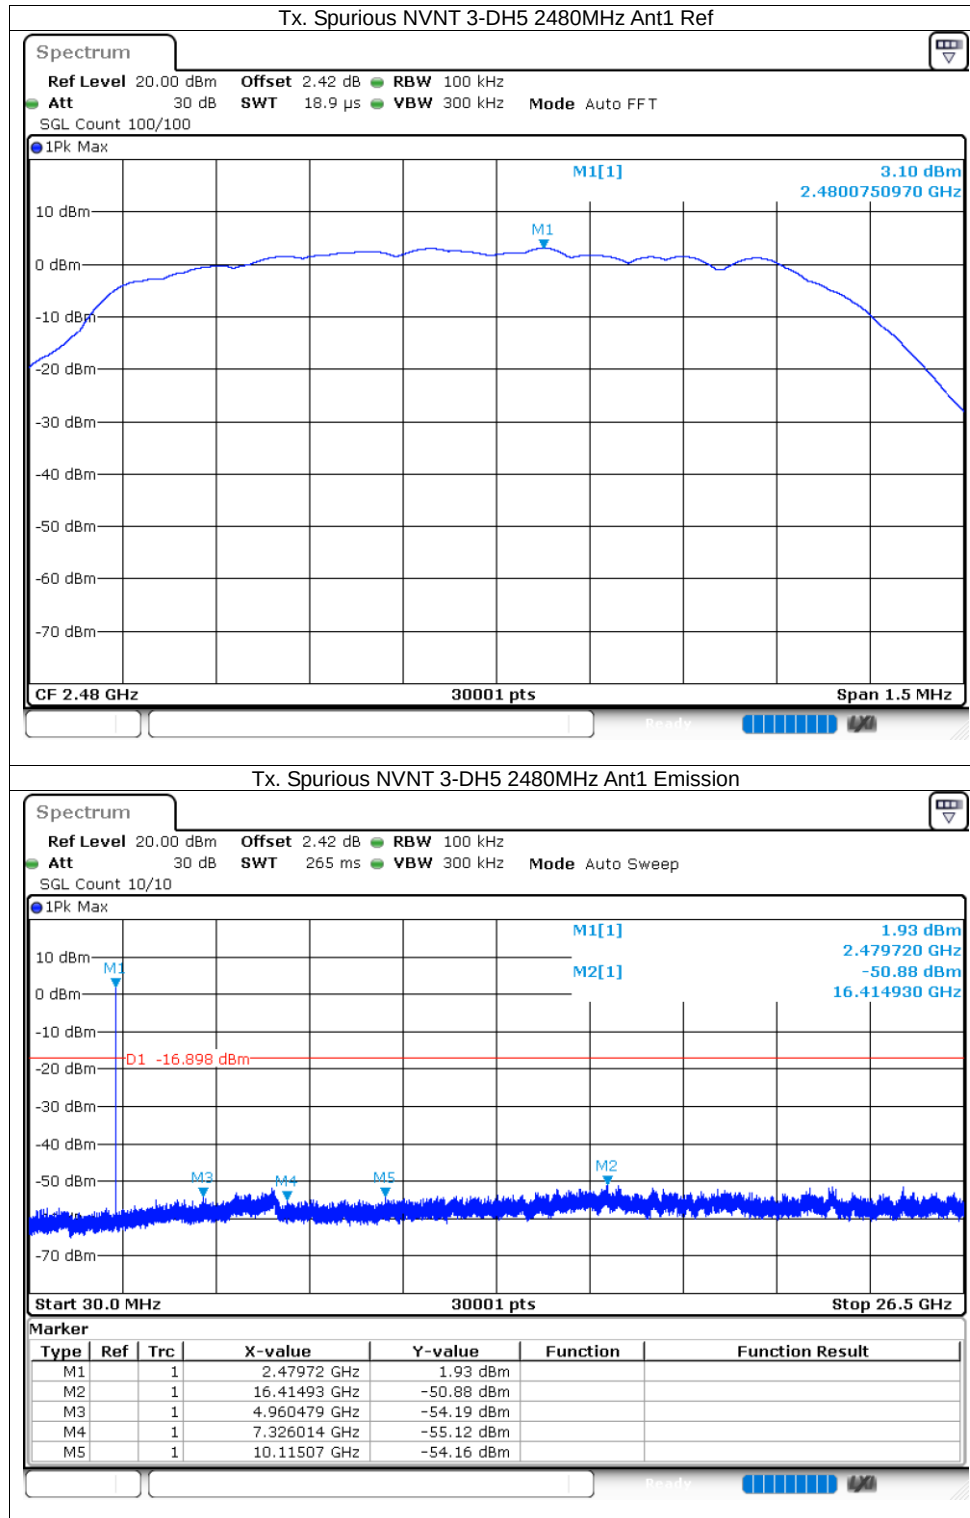

END OF REPORT