





PSD NVNT ac40 5230MHz Ant2

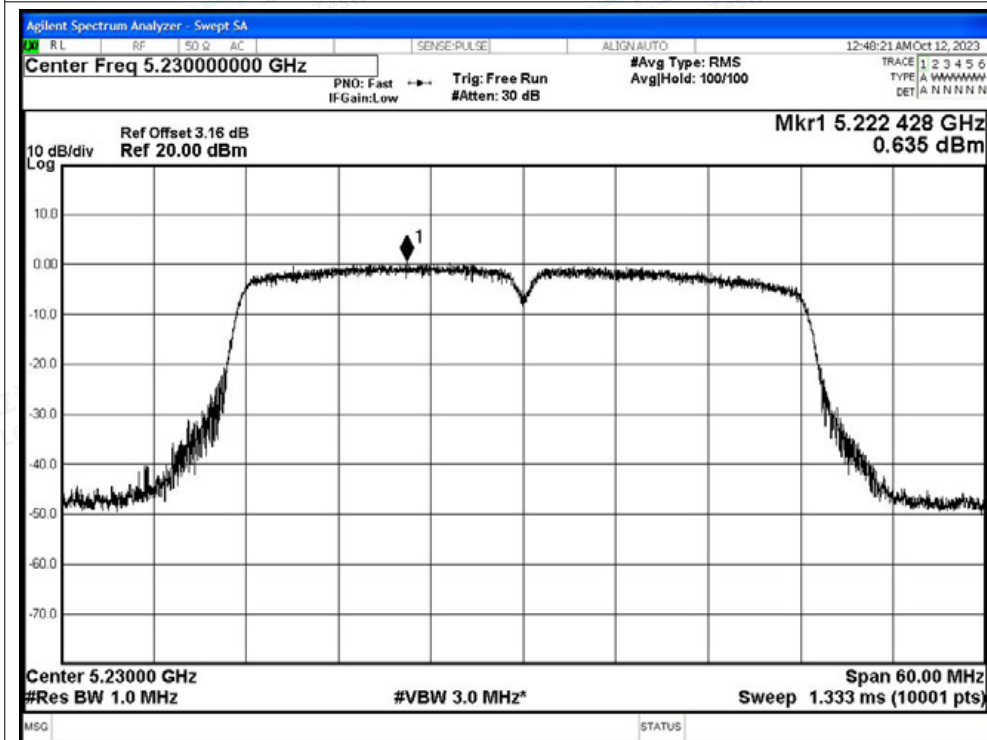

PSD NVNT ac80 5210MHz Ant2

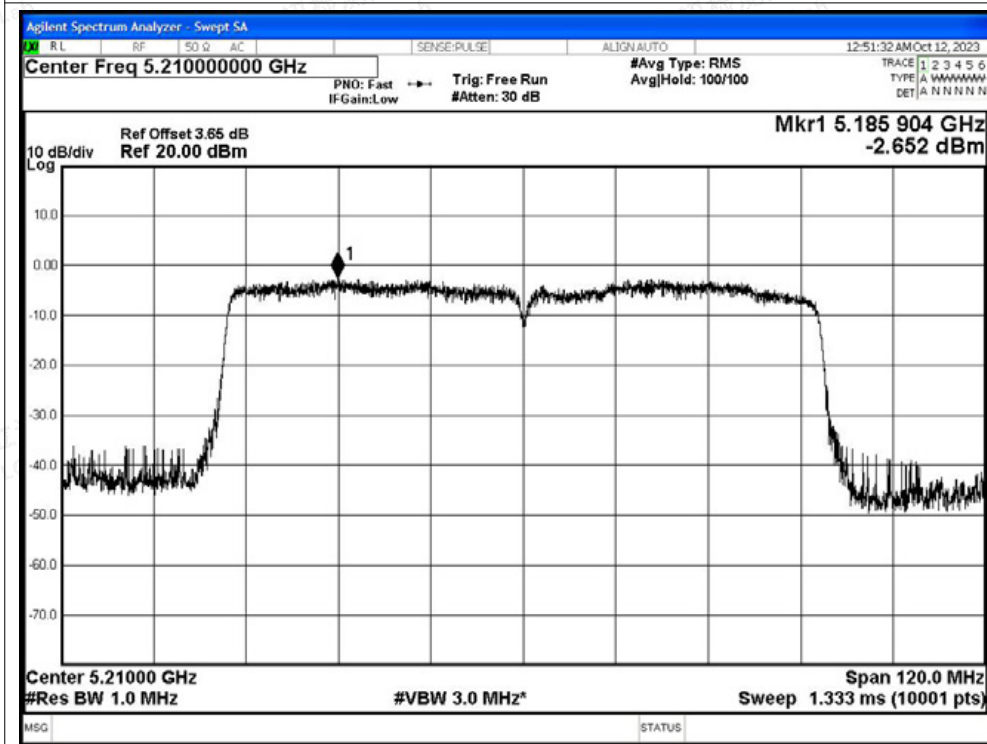



D.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant1	4500	-50.12	2	47.11	Peak	68.2	Pass
NVNT	a	5180	Ant1	4500	-57.13	2	40.1	Average	54	Pass
NVNT	a	5180	Ant1	5095.7	-45.3	2	51.93	Peak	68.2	Pass
NVNT	a	5180	Ant1	5149.6	-53.05	2	44.18	Average	54	Pass
NVNT	a	5180	Ant1	5150	-46.46	2	50.77	Peak	68.2	Pass
NVNT	a	5180	Ant1	5150	-52.8	2	44.43	Average	54	Pass
NVNT	a	5240	Ant1	5350	-48.13	2	49.1	Peak	68.2	Pass
NVNT	a	5240	Ant1	5350	-55.38	2	41.85	Average	54	Pass
NVNT	a	5240	Ant1	5440.08	-46.53	2	50.7	Peak	68.2	Pass
NVNT	a	5240	Ant1	5353.44	-55.11	2	42.12	Average	54	Pass
NVNT	a	5240	Ant1	5460	-50.98	2	46.25	Peak	68.2	Pass
NVNT	a	5240	Ant1	5460	-56.89	2	40.34	Average	54	Pass
NVNT	n20	5180	Ant1	4500	-49.87	2	47.36	Peak	68.2	Pass
NVNT	n20	5180	Ant1	4500	-57.12	2	40.11	Average	54	Pass
NVNT	n20	5180	Ant1	5145.4	-43.6	2	53.63	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5149.6	-52.07	2	45.16	Average	54	Pass
NVNT	n20	5180	Ant1	5150	-43.83	2	53.4	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5150	-51.91	2	45.32	Average	54	Pass
NVNT	n20	5240	Ant1	5350	-48.49	2	48.74	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5350	-55.35	2	41.88	Average	54	Pass
NVNT	n20	5240	Ant1	5369.76	-46.28	2	50.95	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5371.2	-55.23	2	42	Average	54	Pass
NVNT	n20	5240	Ant1	5460	-50.85	2	46.38	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5460	-57.02	2	40.21	Average	54	Pass
NVNT	n40	5190	Ant1	4500	-50.2	2	47.03	Peak	68.2	Pass
NVNT	n40	5190	Ant1	4500	-56.69	2	40.54	Average	54	Pass
NVNT	n40	5190	Ant1	5145.32	-41.43	2	55.8	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5149.7	-51.3	2	45.93	Average	54	Pass
NVNT	n40	5190	Ant1	5150	-44.86	2	52.37	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5150	-51.3	2	45.93	Average	54	Pass
NVNT	n40	5230	Ant1	5350	-47.1	2	50.13	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5350	-55.13	2	42.1	Average	54	Pass
NVNT	n40	5230	Ant1	5391.15	-45.22	2	52.01	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5357.4	-54.69	2	42.54	Average	54	Pass
NVNT	n40	5230	Ant1	5460	-50.26	2	46.97	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5460	-55.78	2	41.45	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ac20	5180	Ant1	4500	-48.91	2	48.32	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	4500	-56.87	2	40.36	Average	54	Pass
NVNT	ac20	5180	Ant1	5148.2	-38.63	2	58.6	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5148.9	-51.63	2	45.6	Average	54	Pass
NVNT	ac20	5180	Ant1	5150	-44.41	2	52.82	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5150	-51.4	2	45.83	Average	54	Pass
NVNT	ac20	5240	Ant1	5350	-48.91	2	48.32	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5350	-55.42	2	41.81	Average	54	Pass
NVNT	ac20	5240	Ant1	5380.08	-45.35	2	51.88	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5352.24	-55.05	2	42.18	Average	54	Pass
NVNT	ac20	5240	Ant1	5460	-49.33	2	47.9	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5460	-56.88	2	40.35	Average	54	Pass
NVNT	ac40	5190	Ant1	4500	-49.89	2	47.34	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	4500	-56.75	2	40.48	Average	54	Pass
NVNT	ac40	5190	Ant1	5146.78	-42.9	2	54.33	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5149.7	-52.3	2	44.93	Average	54	Pass
NVNT	ac40	5190	Ant1	5150	-41.47	2	55.76	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5150	-52.3	2	44.93	Average	54	Pass
NVNT	ac40	5230	Ant1	5350	-49.89	2	47.34	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5350	-55.93	2	41.3	Average	54	Pass
NVNT	ac40	5230	Ant1	5404.11	-46.16	2	51.07	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5357.67	-55.81	2	41.42	Average	54	Pass
NVNT	ac40	5230	Ant1	5460	-47.71	2	49.52	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5460	-56.32	2	40.91	Average	54	Pass
NVNT	ac80	5210	Ant1	5350	-46.67	2	50.56	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5350	-53.44	2	43.79	Average	54	Pass
NVNT	ac80	5210	Ant1	5352.75	-38.14	2	59.09	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5351.43	-53.25	2	43.98	Average	54	Pass
NVNT	ac80	5210	Ant1	5460	-48.68	2	48.55	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5460	-55.35	2	41.88	Average	54	Pass
NVNT	ac80	5210	Ant1	4500	-50.9	2	46.33	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	4500	-56.74	2	40.49	Average	54	Pass
NVNT	ac80	5210	Ant1	5121.73	-39.71	2	57.52	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5149.38	-49.99	2	47.24	Average	54	Pass
NVNT	ac80	5210	Ant1	5150	-41.85	2	55.38	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5150	-50.68	2	46.55	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5180MHz Ant1 Peak

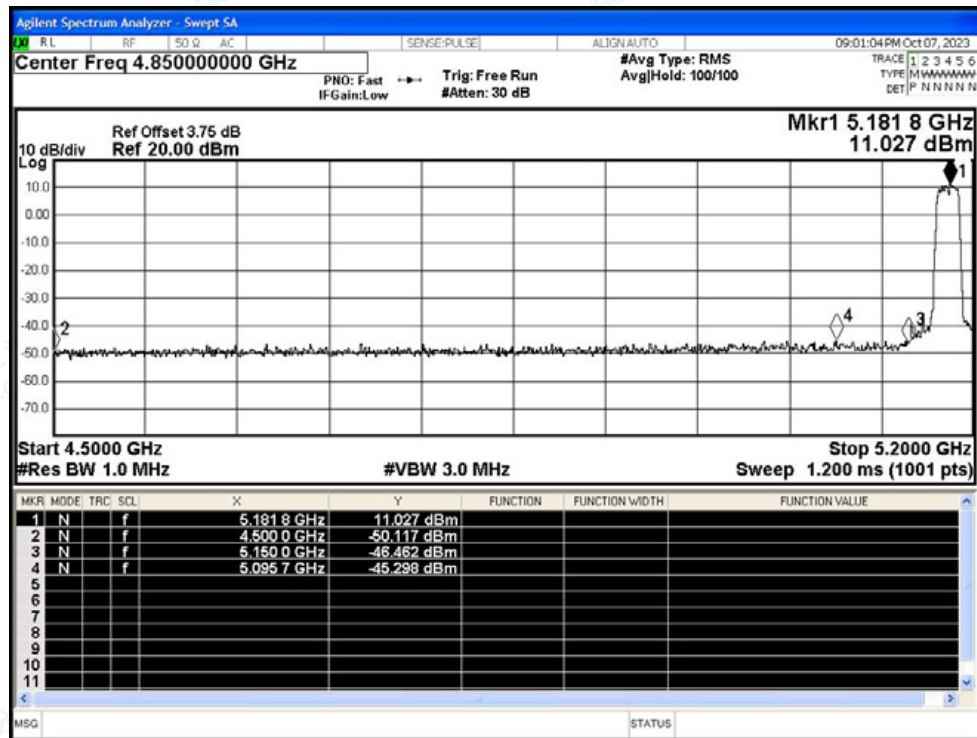

Restrict Band NVNT a 5180MHz Ant1 Average

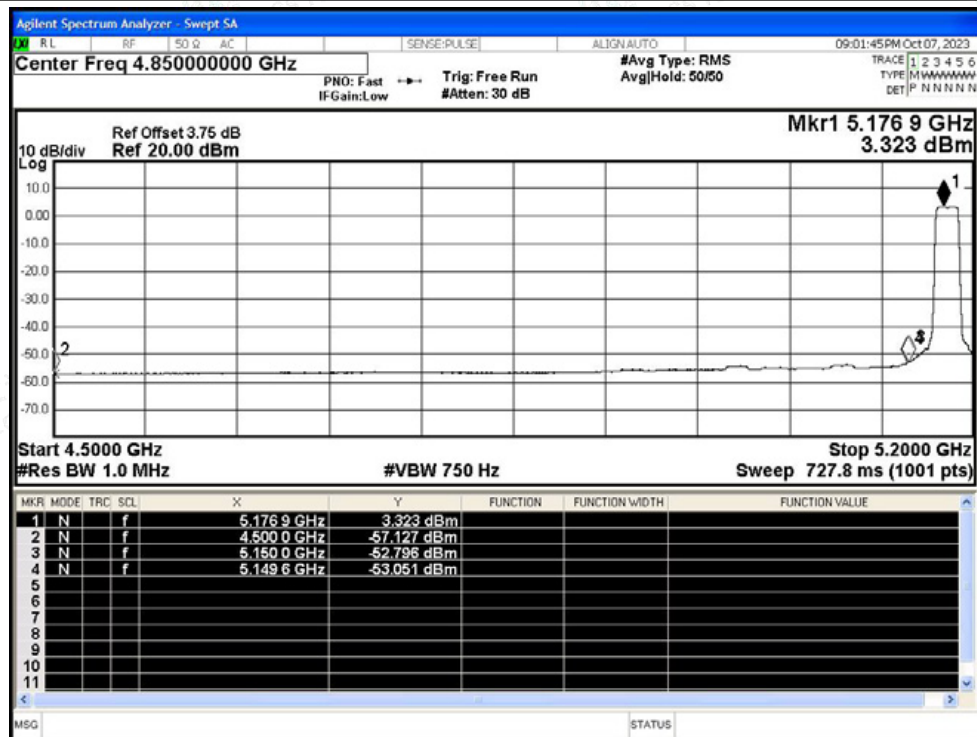

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant1 Peak

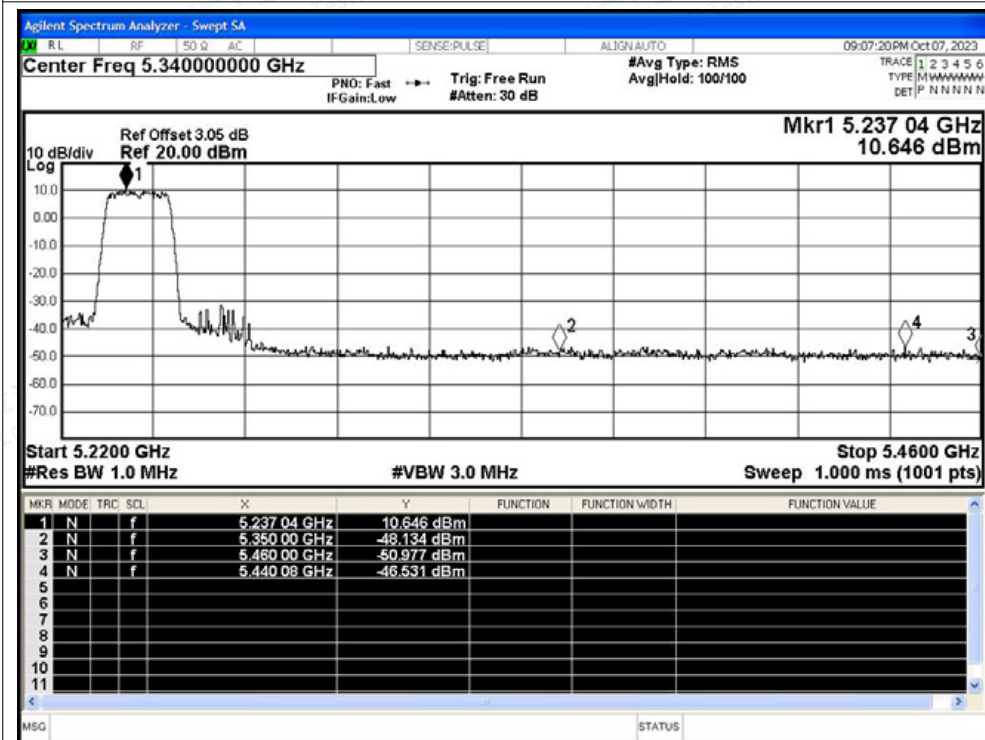

Restrict Band NVNT a 5240MHz Ant1 Average

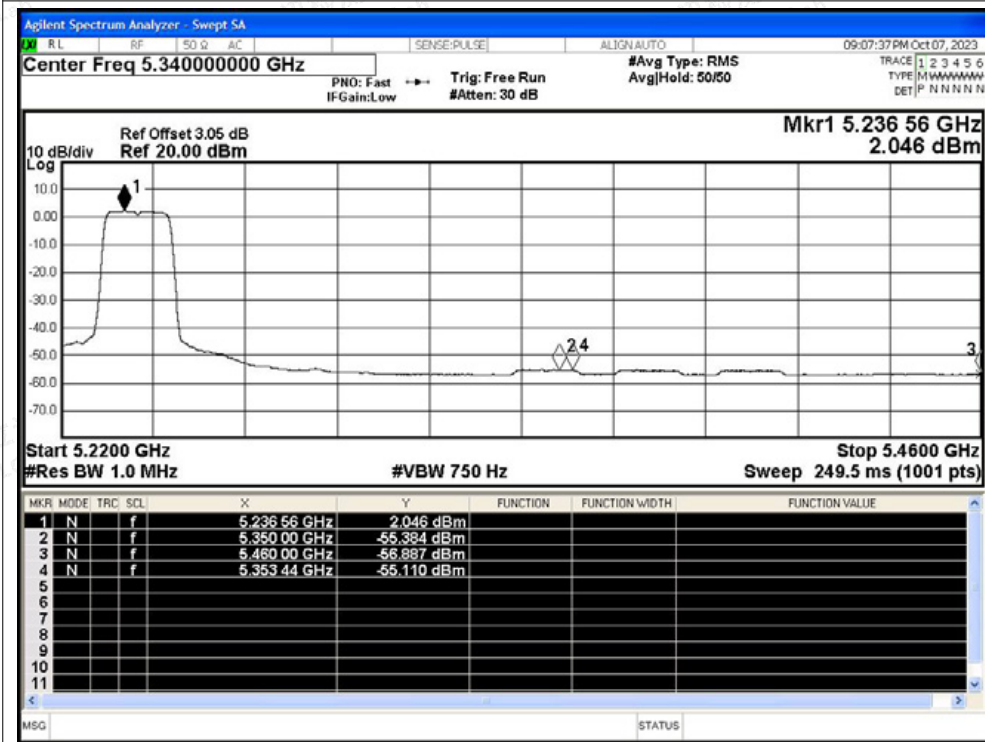

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant1 Peak

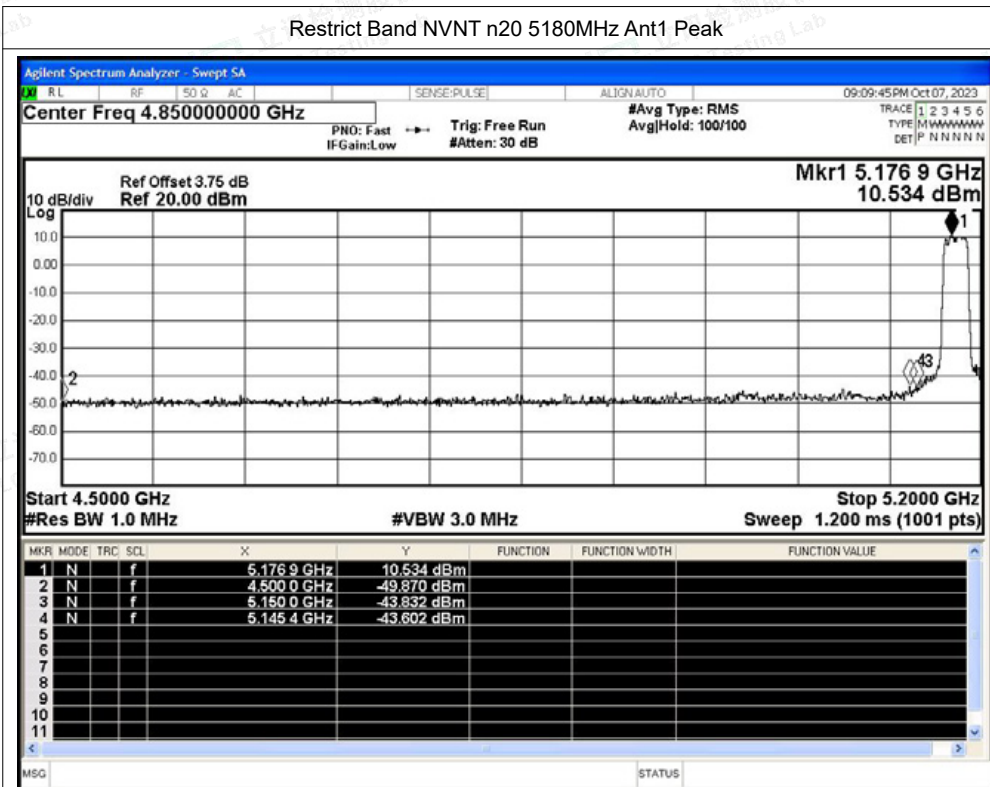


Restrict Band NVNT n20 5180MHz Ant1 Average

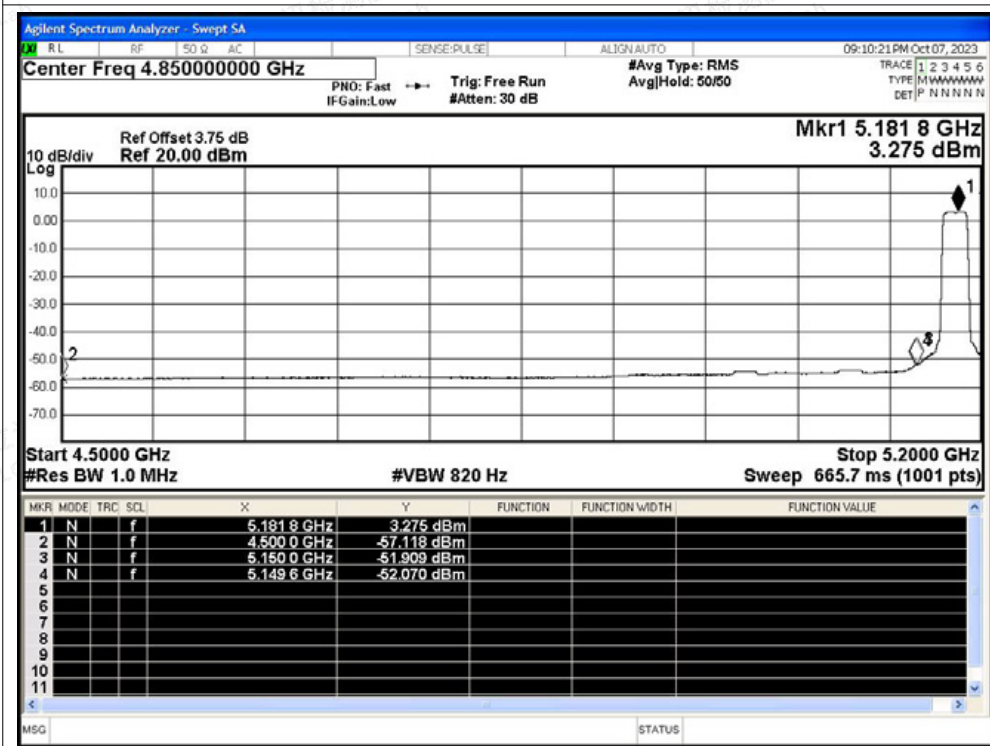




Restrict Band NVNT n20 5240MHz Ant1 Peak

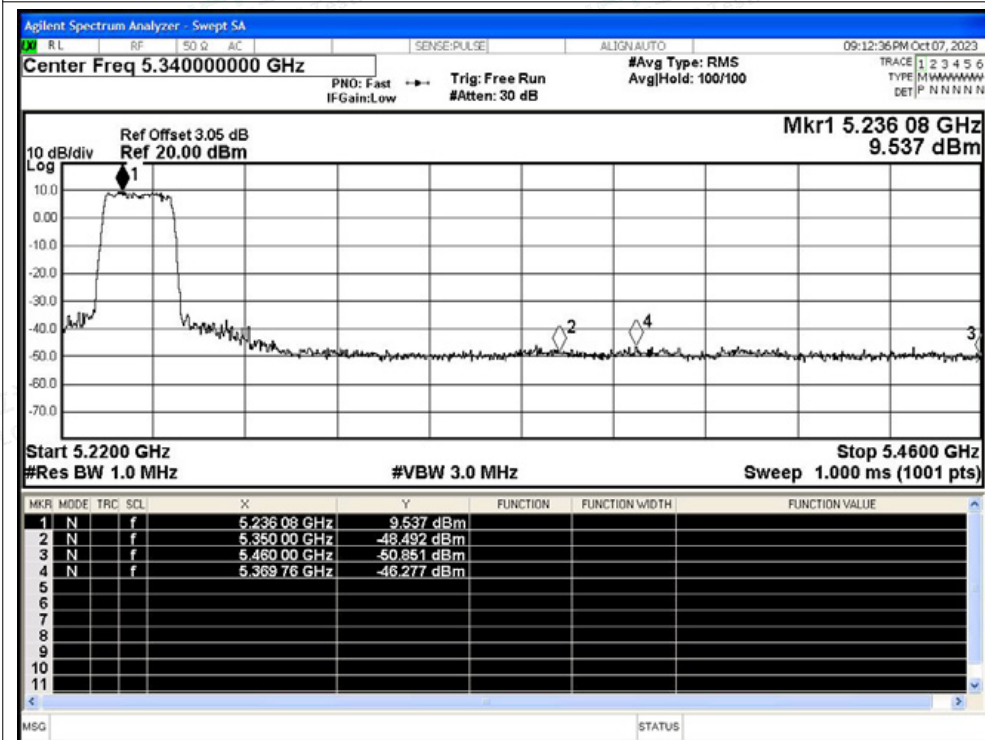


Restrict Band NVNT n20 5240MHz Ant1 Average

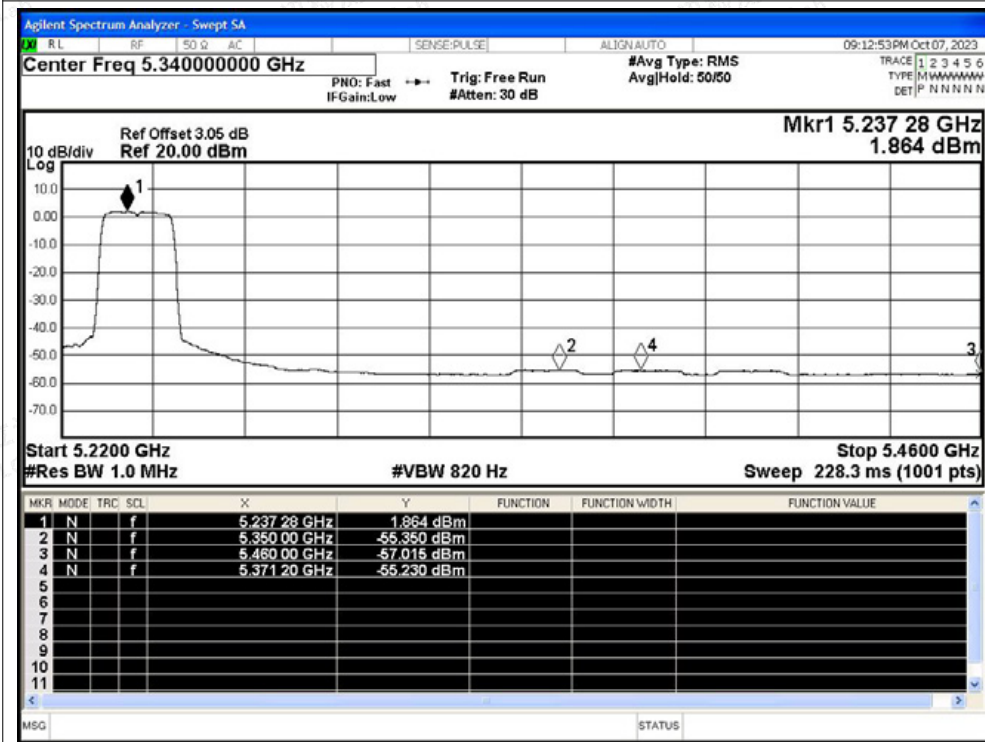




Restrict Band NVNT n40 5190MHz Ant1 Peak

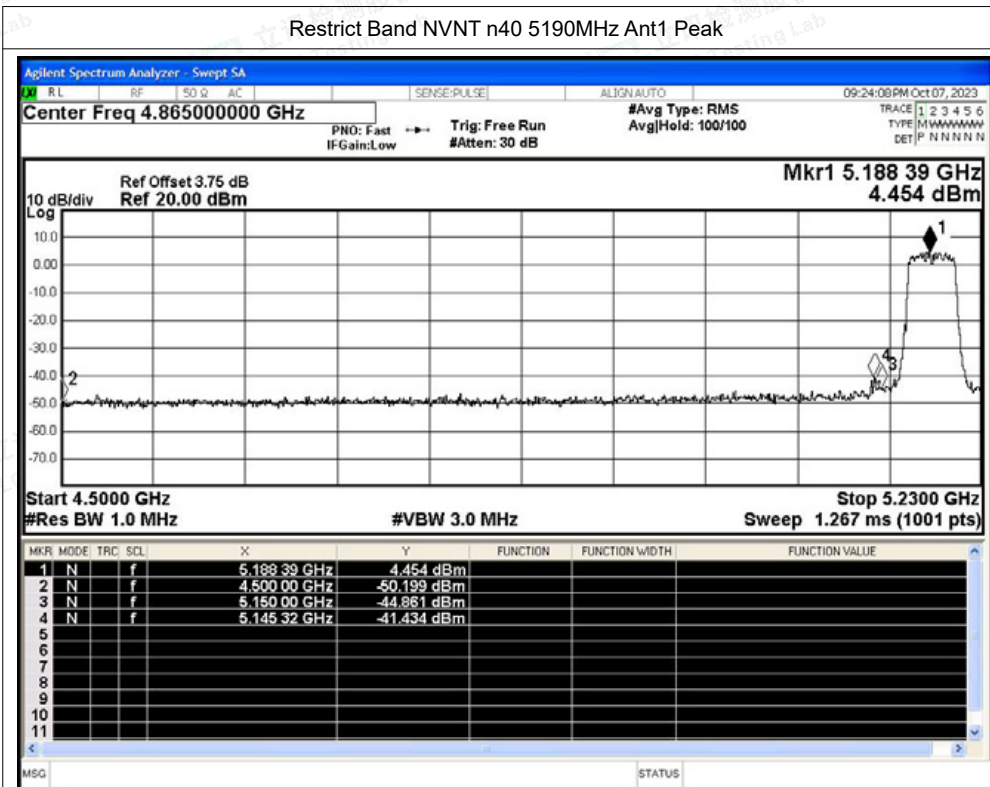

Restrict Band NVNT n40 5190MHz Ant1 Average

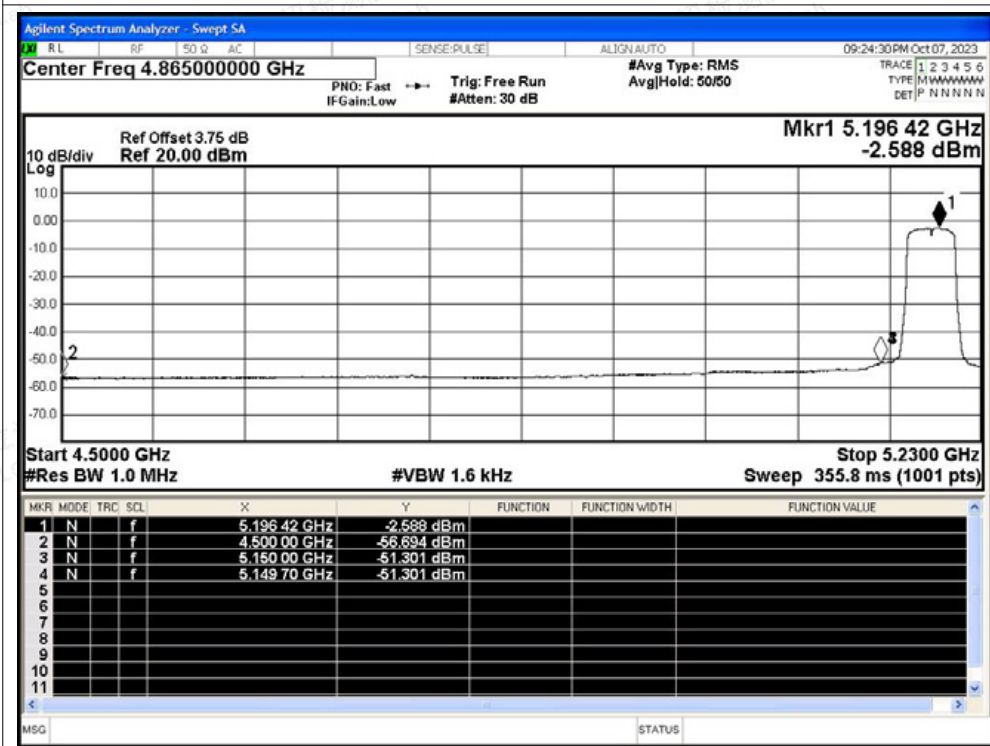

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant1 Peak

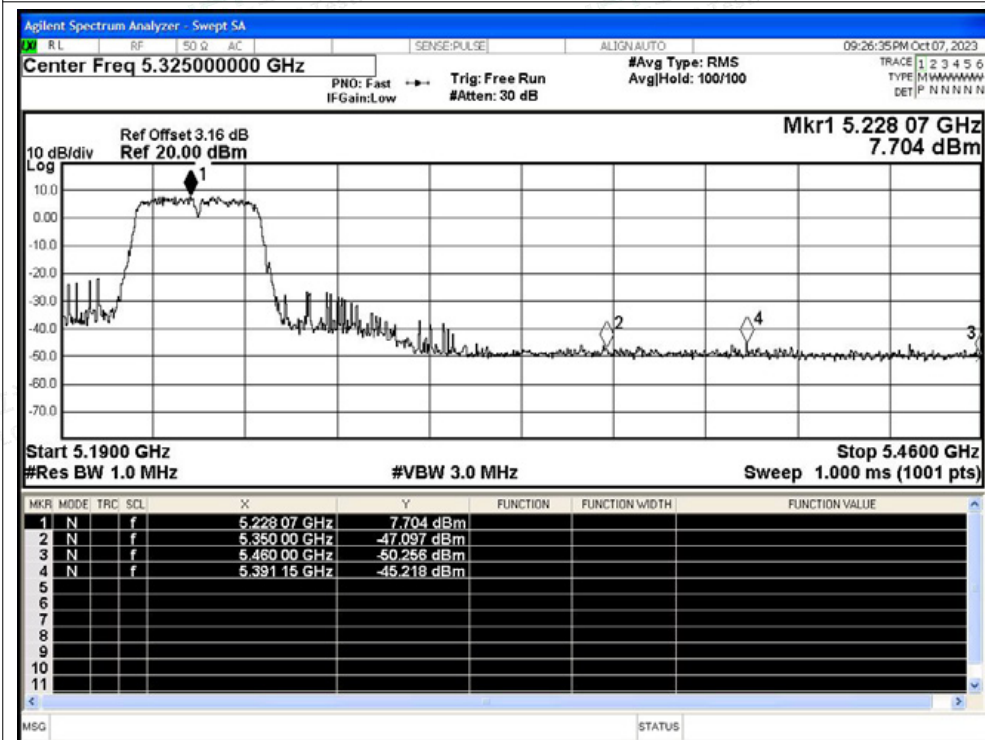


Restrict Band NVNT n40 5230MHz Ant1 Average

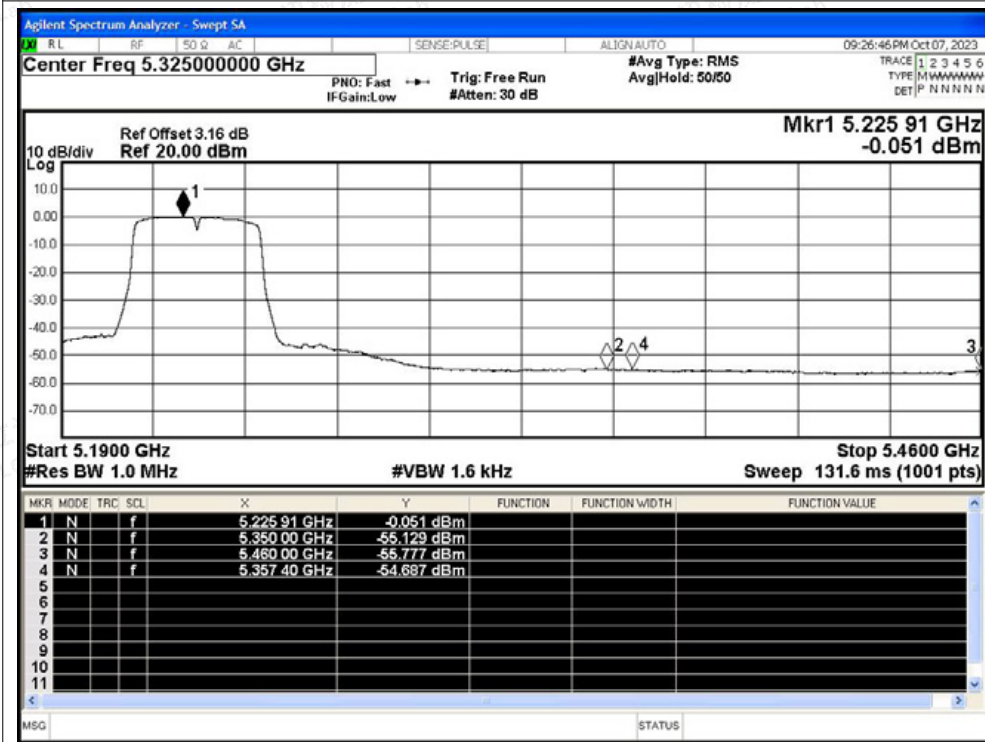




Restrict Band NVNT ac20 5180MHz Ant1 Peak

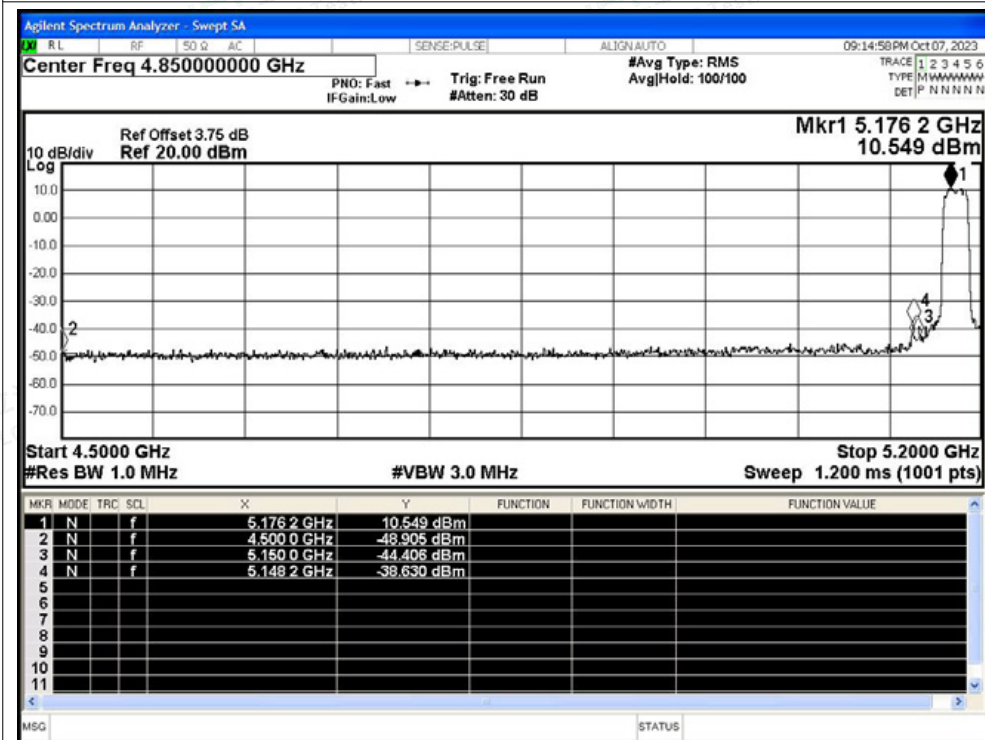


Restrict Band NVNT ac20 5180MHz Ant1 Average

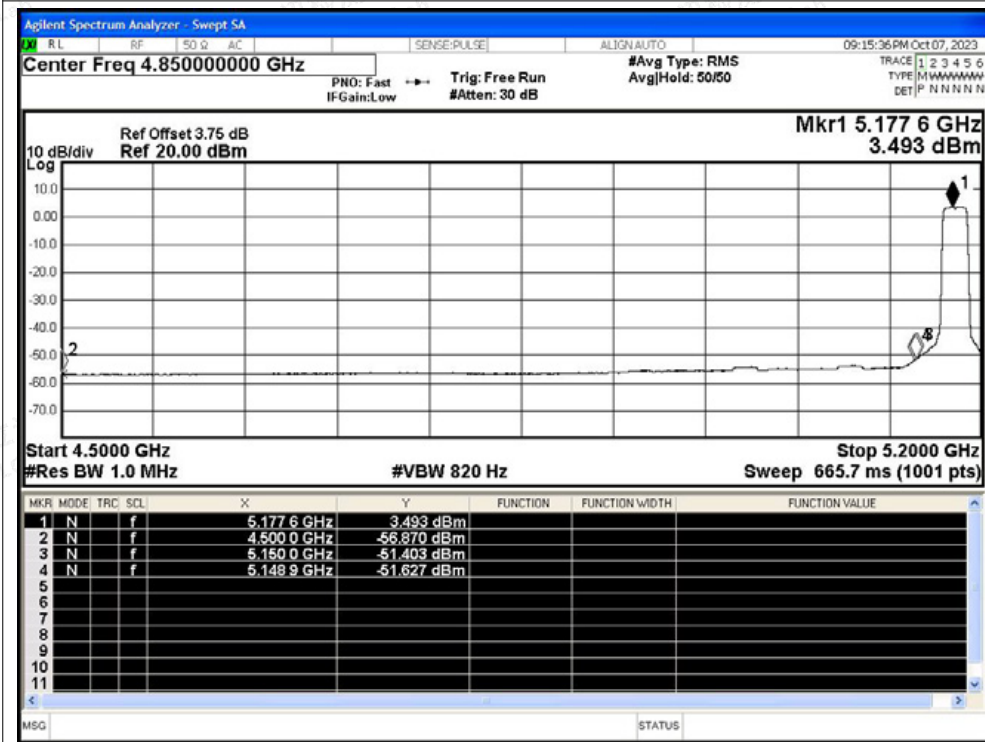




Restrict Band NVNT ac20 5240MHz Ant1 Peak

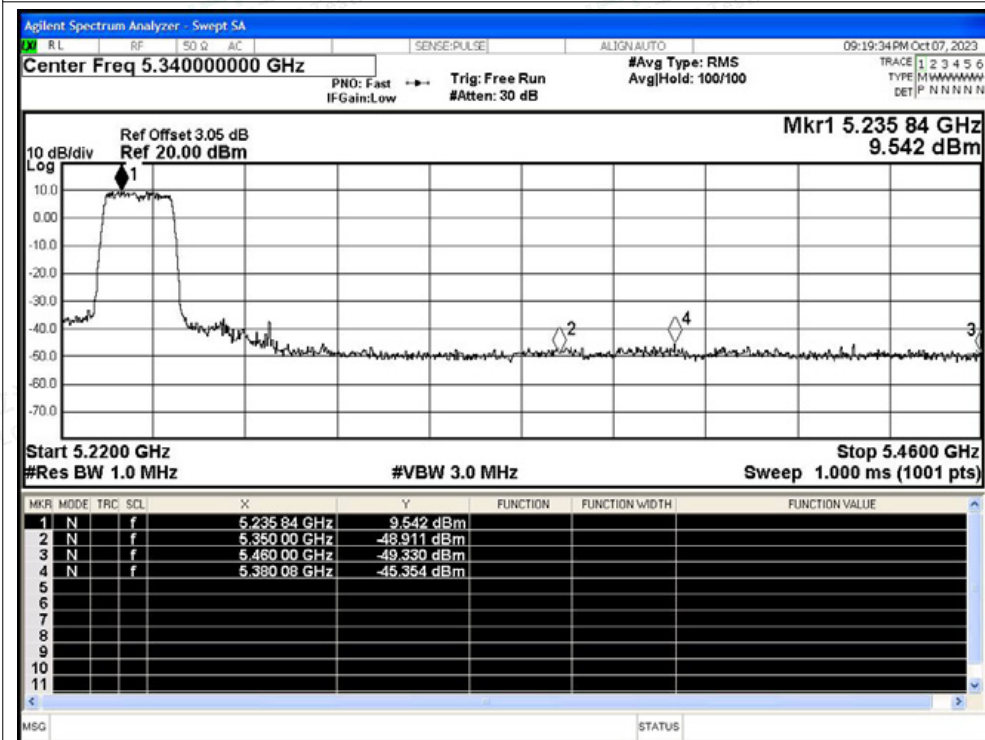


Restrict Band NVNT ac20 5240MHz Ant1 Average

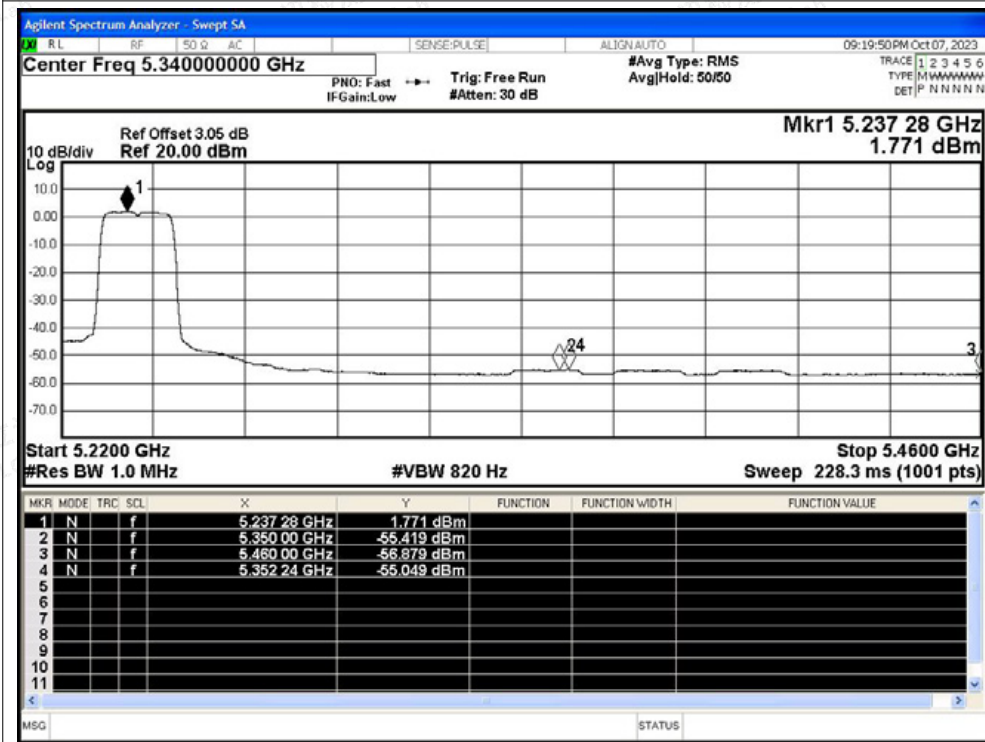




Restrict Band NVNT ac40 5190MHz Ant1 Peak

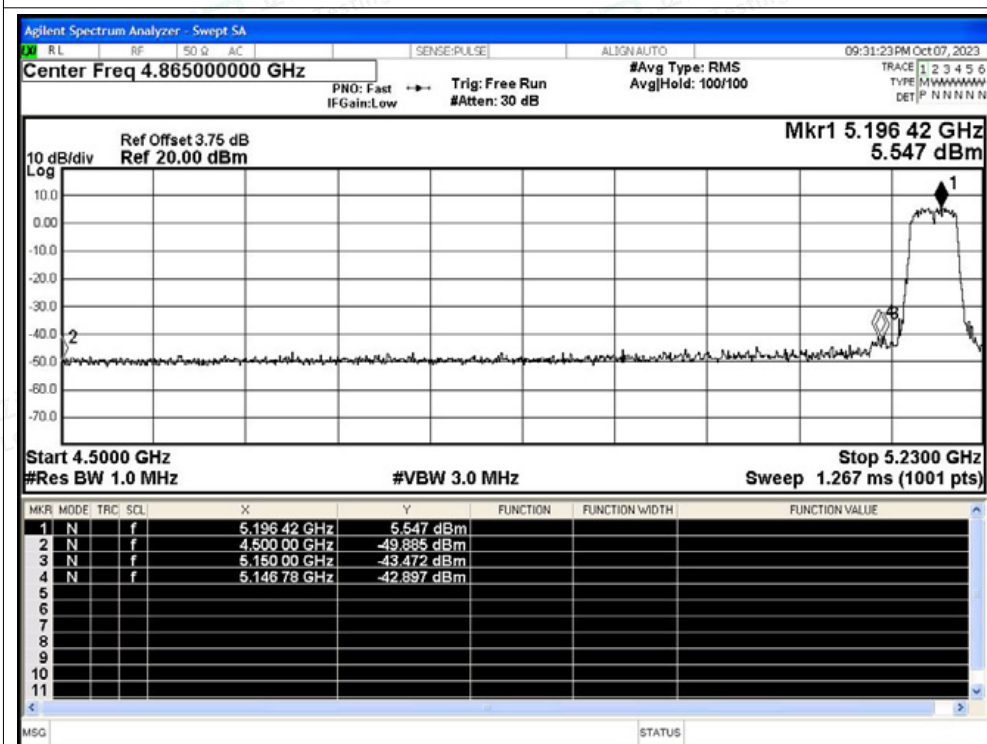

Restrict Band NVNT ac40 5190MHz Ant1 Average

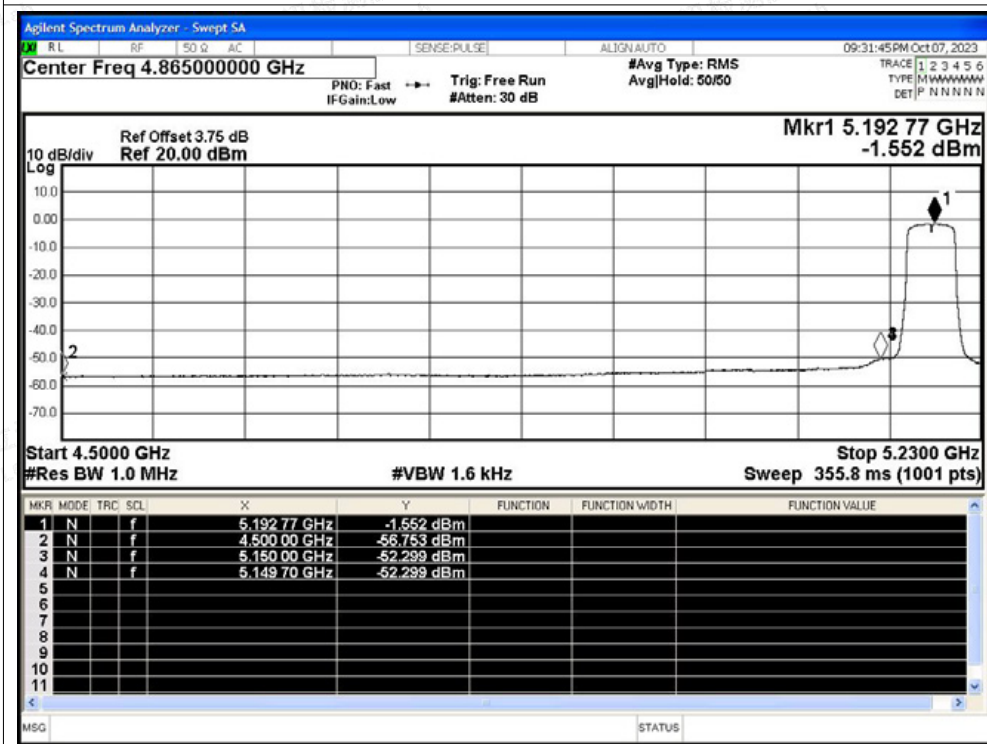

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant1 Peak

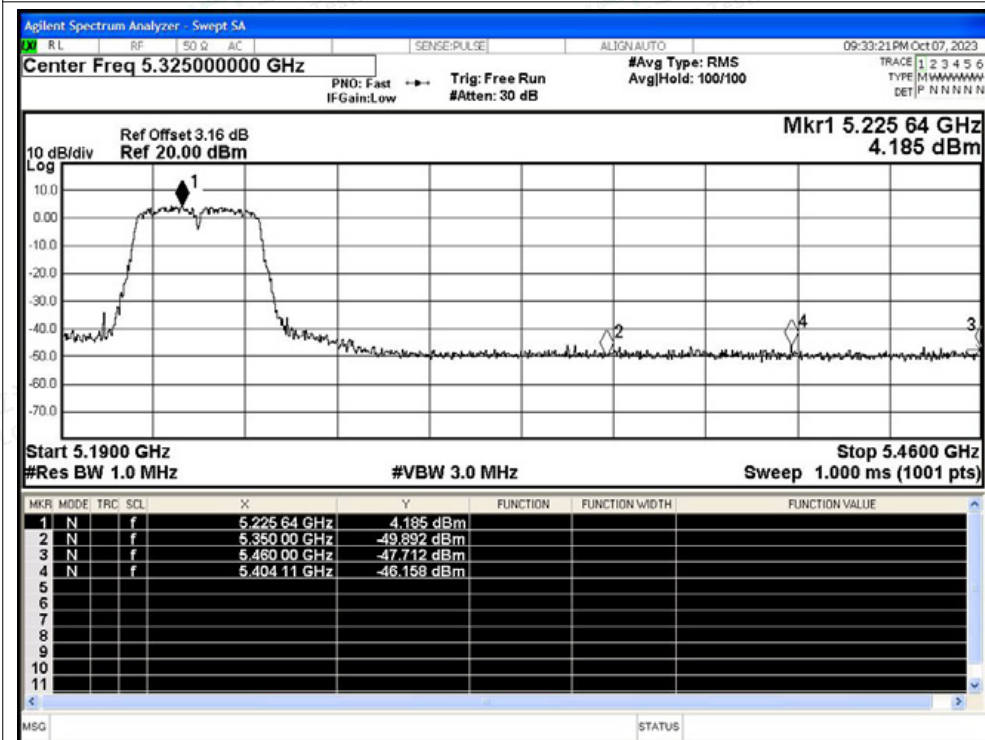

Restrict Band NVNT ac40 5230MHz Ant1 Average

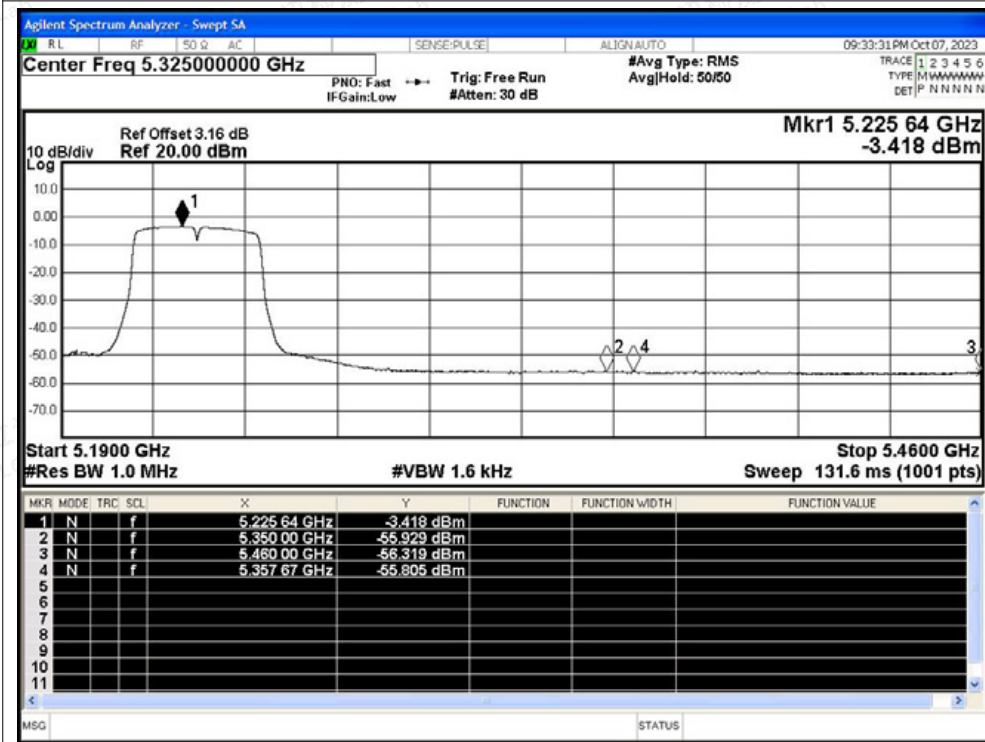

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

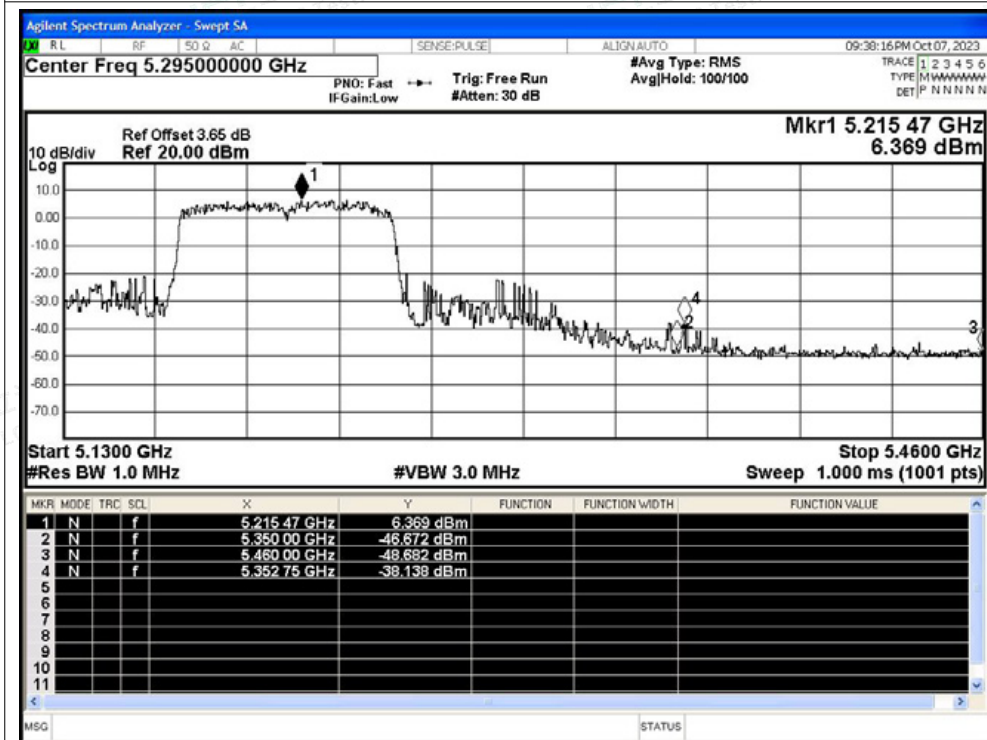


Restrict Band NVNT ac80 5210MHz Ant1 Average

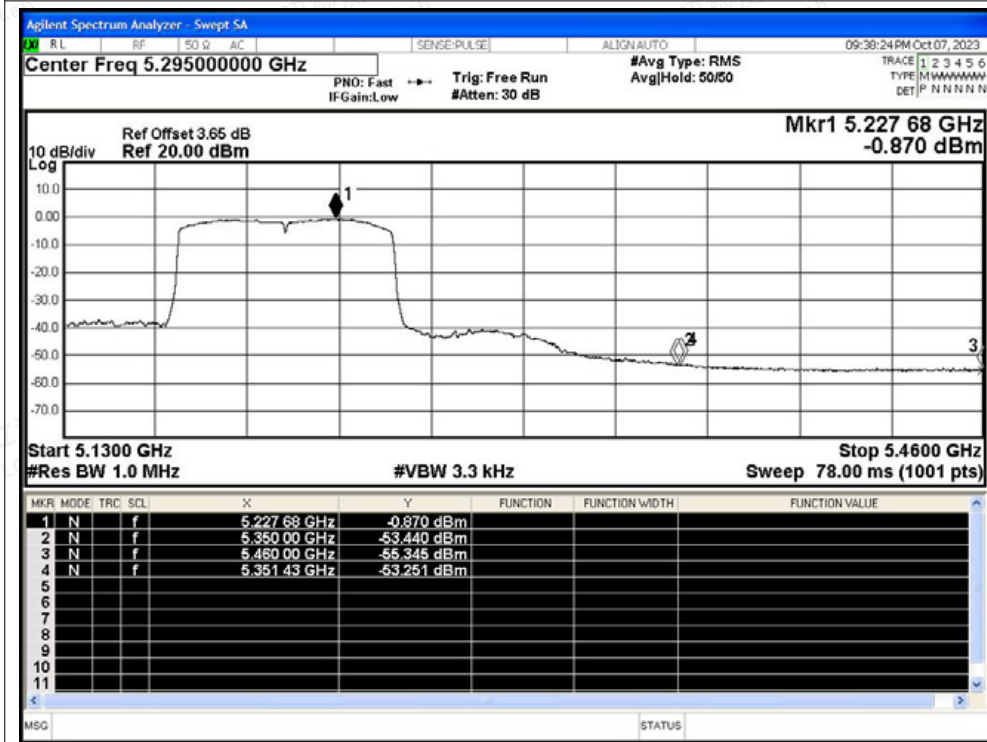




Restrict Band NVNT ac80 5210MHz Ant1 Peak

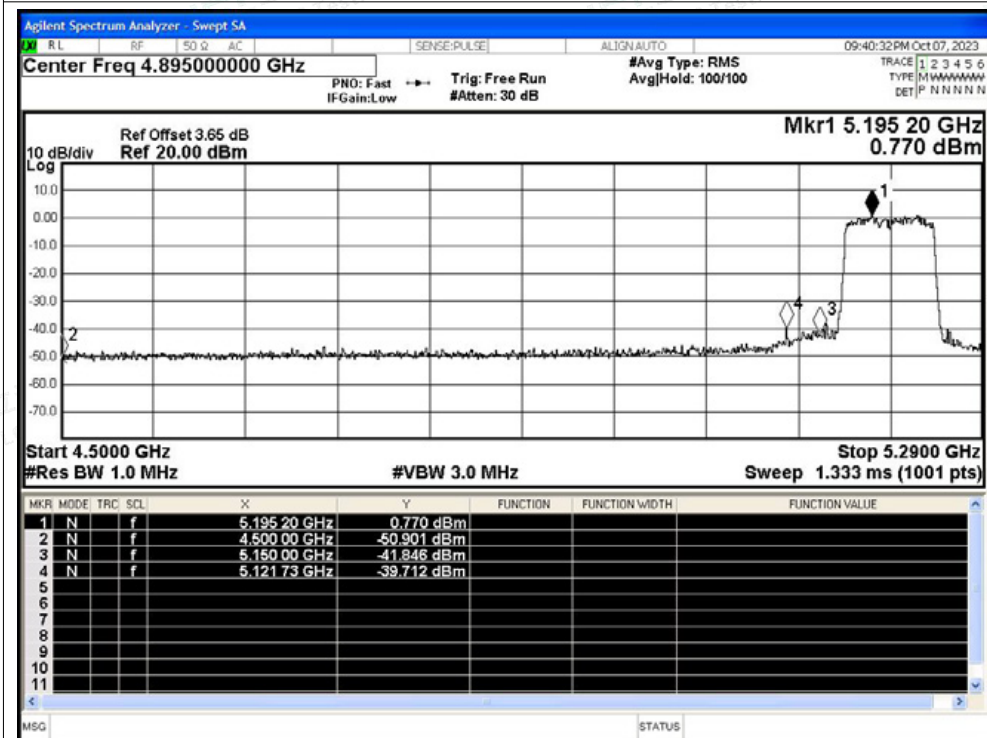

Restrict Band NVNT ac80 5210MHz Ant1 Average

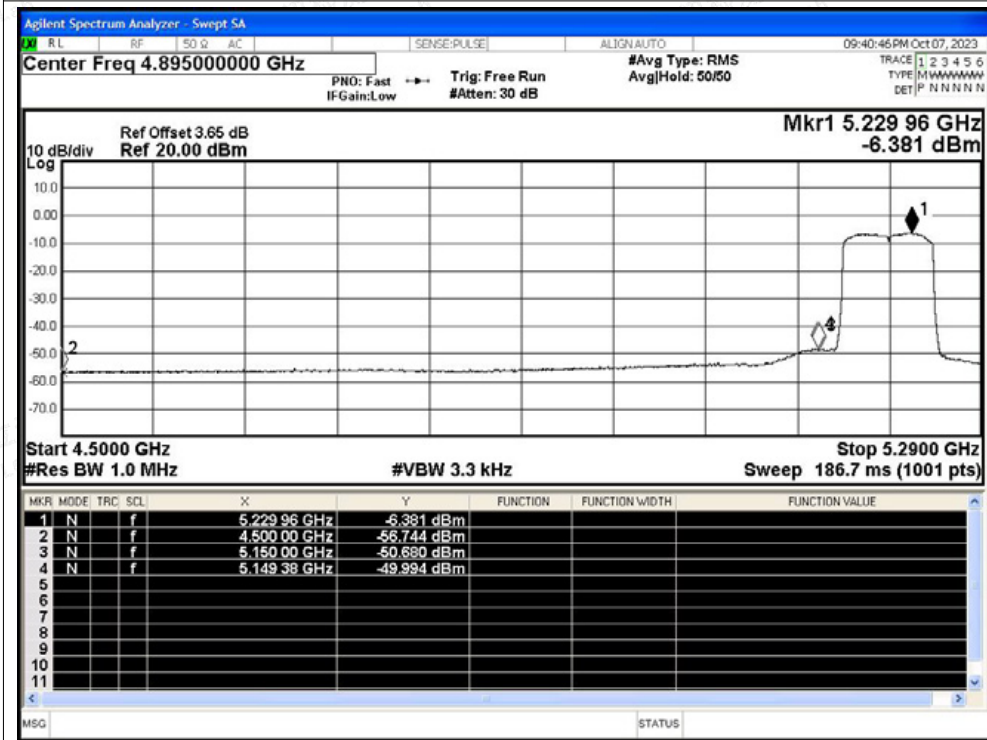

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant2	4500	-50.9	2	46.33	Peak	68.2	Pass
NVNT	a	5180	Ant2	4500	-57.35	2	39.88	Average	54	Pass
NVNT	a	5180	Ant2	5148.2	-43.22	2	54.01	Peak	68.2	Pass
NVNT	a	5180	Ant2	5149.6	-52.09	2	45.14	Average	54	Pass
NVNT	a	5180	Ant2	5150	-44.46	2	52.77	Peak	68.2	Pass
NVNT	a	5180	Ant2	5150	-52.04	2	45.19	Average	54	Pass
NVNT	a	5240	Ant2	5350	-46.36	2	50.87	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350	-52.39	2	44.84	Average	54	Pass
NVNT	a	5240	Ant2	5352	-44.22	2	53.01	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350.32	-52.27	2	44.96	Average	54	Pass
NVNT	a	5240	Ant2	5460	-49.13	2	48.1	Peak	68.2	Pass
NVNT	a	5240	Ant2	5460	-56.14	2	41.09	Average	54	Pass
NVNT	n20	5180	Ant2	4500	-50.6	2	46.63	Peak	68.2	Pass
NVNT	n20	5180	Ant2	4500	-57.16	2	40.07	Average	54	Pass
NVNT	n20	5180	Ant2	5149.6	-43.84	2	53.39	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5149.6	-51.37	2	45.86	Average	54	Pass
NVNT	n20	5180	Ant2	5150	-42.32	2	54.91	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5150	-50.9	2	46.33	Average	54	Pass
NVNT	n20	5240	Ant2	5350	-44.88	2	52.35	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5350	-52.5	2	44.73	Average	54	Pass
NVNT	n20	5240	Ant2	5366.88	-43.53	2	53.7	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5352.72	-52.26	2	44.97	Average	54	Pass
NVNT	n20	5240	Ant2	5460	-47.25	2	49.98	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5460	-56.2	2	41.03	Average	54	Pass
NVNT	n40	5190	Ant2	4500	-50.37	2	46.86	Peak	68.2	Pass
NVNT	n40	5190	Ant2	4500	-56.99	2	40.24	Average	54	Pass
NVNT	n40	5190	Ant2	5148.97	-42.24	2	54.99	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5149.7	-49.86	2	47.37	Average	54	Pass
NVNT	n40	5190	Ant2	5150	-42.82	2	54.41	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5150	-49.86	2	47.37	Average	54	Pass
NVNT	n40	5230	Ant2	5350	-47.04	2	50.19	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5350	-52.62	2	44.61	Average	54	Pass
NVNT	n40	5230	Ant2	5354.7	-44.7	2	52.53	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5351.73	-52.6	2	44.63	Average	54	Pass
NVNT	n40	5230	Ant2	5460	-47.5	2	49.73	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5460	-54.7	2	42.53	Average	54	Pass
NVNT	ac20	5180	Ant2	4500	-49.35	2	47.88	Peak	68.2	Pass






NVNT	ac20	5180	Ant2	4500	-57.28	2	39.95	Average	54	Pass
NVNT	ac20	5180	Ant2	5149.6	-39.32	2	57.91	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5149.6	-49.95	2	47.28	Average	54	Pass
NVNT	ac20	5180	Ant2	5150	-39.83	2	57.4	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5150	-49.56	2	47.67	Average	54	Pass
NVNT	ac20	5240	Ant2	5350	-46.71	2	50.52	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350	-53.26	2	43.97	Average	54	Pass
NVNT	ac20	5240	Ant2	5351.76	-44.14	2	53.09	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5351.52	-53.05	2	44.18	Average	54	Pass
NVNT	ac20	5240	Ant2	5460	-48.35	2	48.88	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5460	-56.18	2	41.05	Average	54	Pass
NVNT	ac40	5190	Ant2	4500	-50.44	2	46.79	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4500	-57.03	2	40.2	Average	54	Pass
NVNT	ac40	5190	Ant2	5147.51	-32.03	2	65.2	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5149.7	-46.57	2	50.66	Average	54	Pass
NVNT	ac40	5190	Ant2	5150	-37.1	2	60.13	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5150	-46.57	2	50.66	Average	54	Pass
NVNT	ac40	5230	Ant2	5350	-46.8	2	50.43	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350	-52.25	2	44.98	Average	54	Pass
NVNT	ac40	5230	Ant2	5354.7	-44.42	2	52.81	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5352.54	-51.53	2	45.7	Average	54	Pass
NVNT	ac40	5230	Ant2	5460	-48.48	2	48.75	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5460	-54.36	2	42.87	Average	54	Pass
NVNT	ac80	5210	Ant2	5350	-46.88	2	50.35	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350	-53.46	2	43.77	Average	54	Pass
NVNT	ac80	5210	Ant2	5435.58	-45.27	2	51.96	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5352.09	-53.26	2	43.97	Average	54	Pass
NVNT	ac80	5210	Ant2	5460	-48.34	2	48.89	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5460	-54.49	2	42.74	Average	54	Pass
NVNT	ac80	5210	Ant2	4500	-49.28	2	47.95	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	4500	-56.53	2	40.7	Average	54	Pass
NVNT	ac80	5210	Ant2	5145.43	-37.83	2	59.4	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5147.01	-47.33	2	49.90	Average	54	Pass
NVNT	ac80	5210	Ant2	5150	-39.44	2	57.79	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5150	-47.77	2	49.46	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5180MHz Ant2 Peak

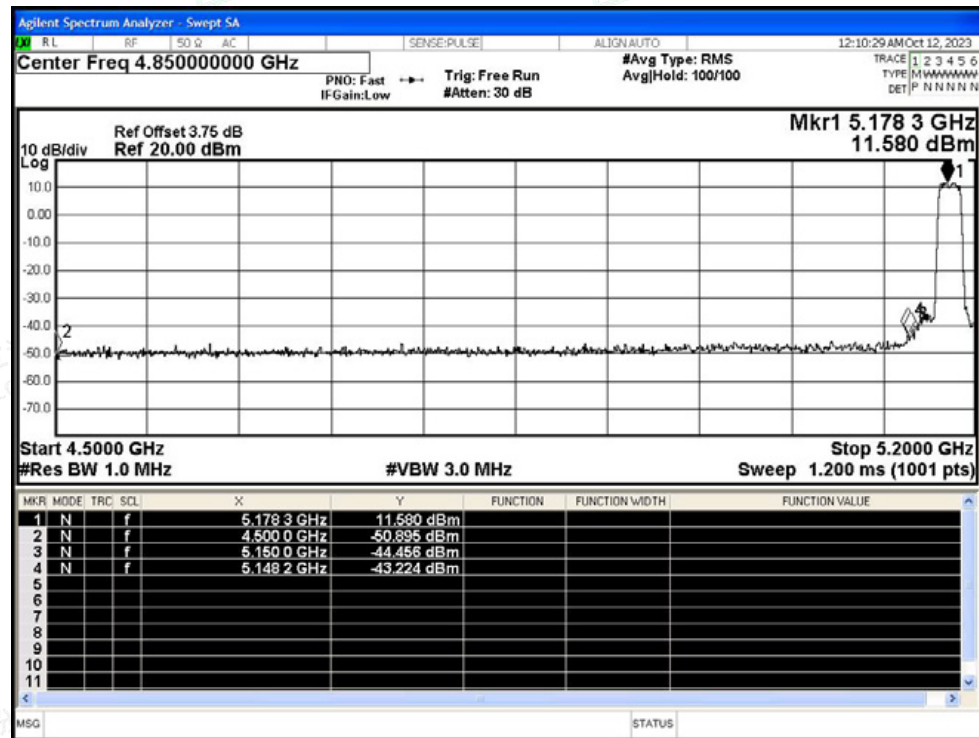

Restrict Band NVNT a 5180MHz Ant2 Average

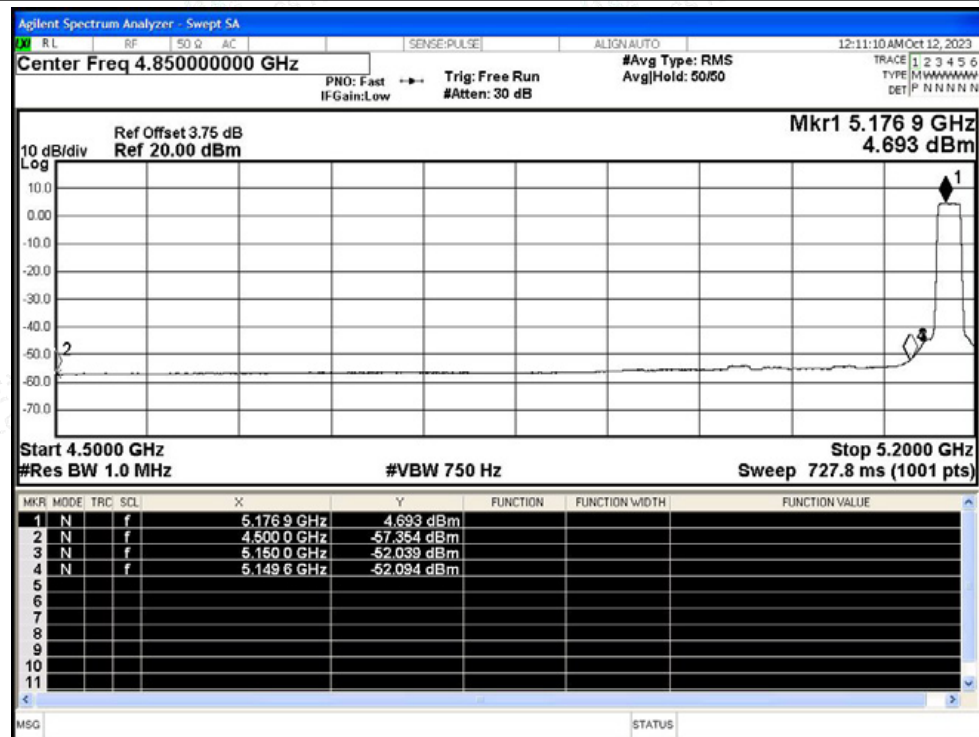

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant2 Peak

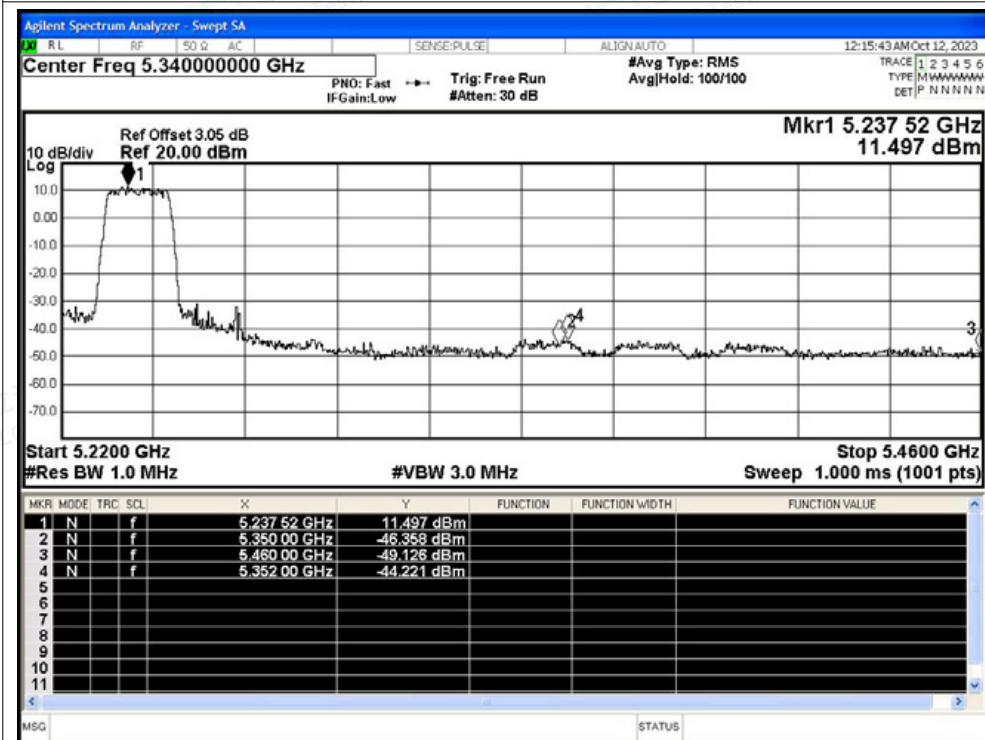


Restrict Band NVNT a 5240MHz Ant2 Average

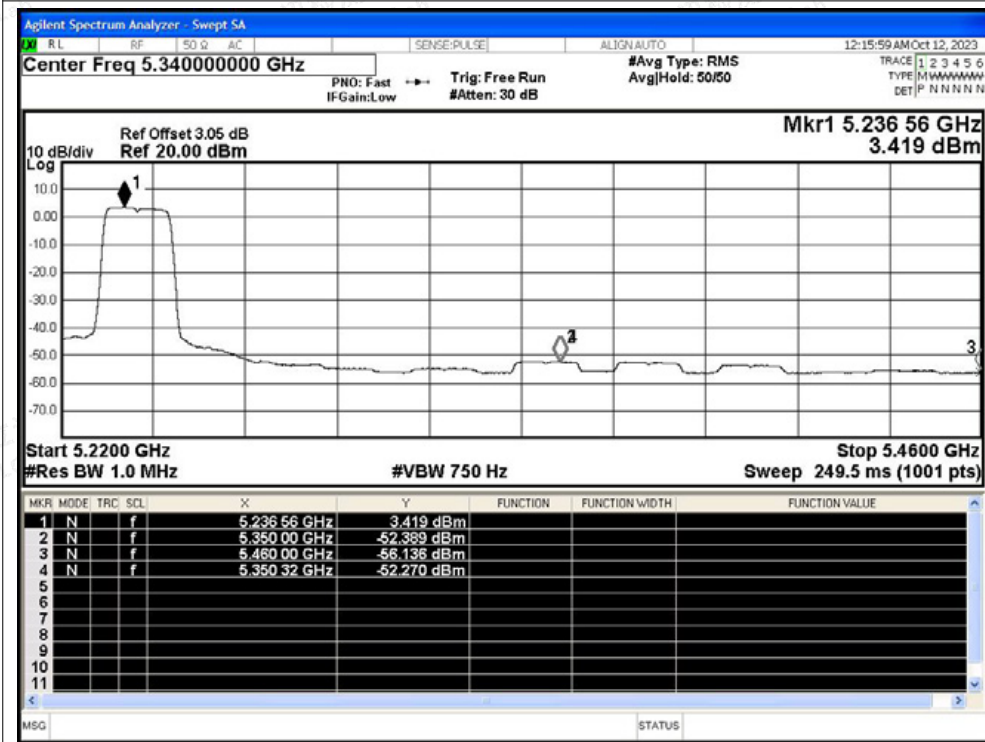




Restrict Band NVNT n20 5180MHz Ant2 Peak

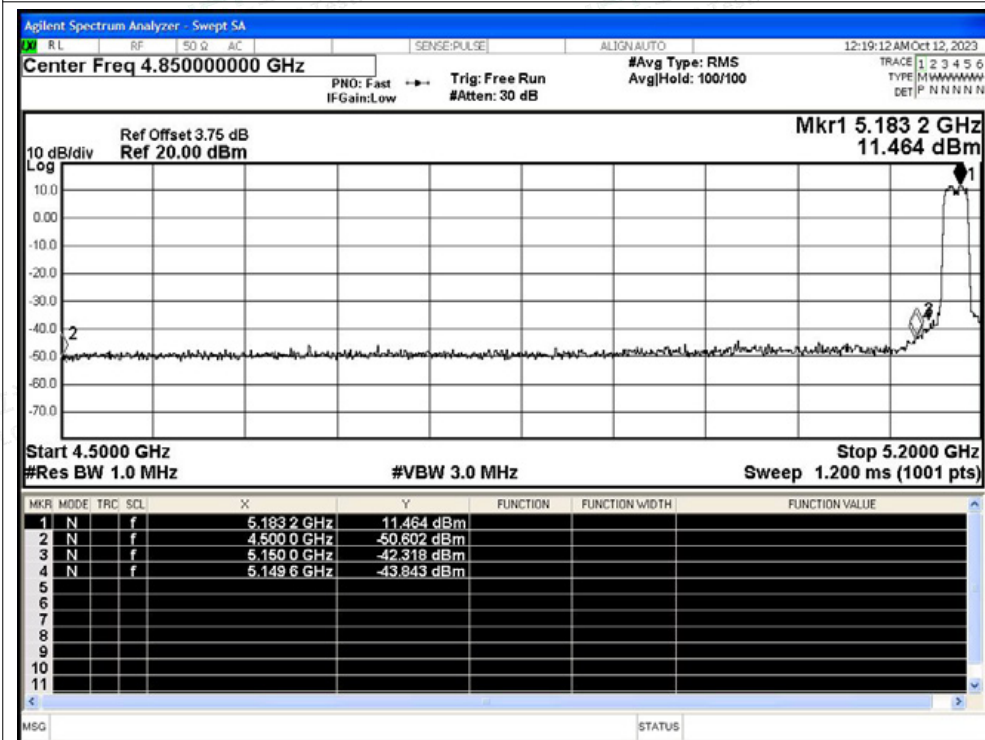


Restrict Band NVNT n20 5180MHz Ant2 Average

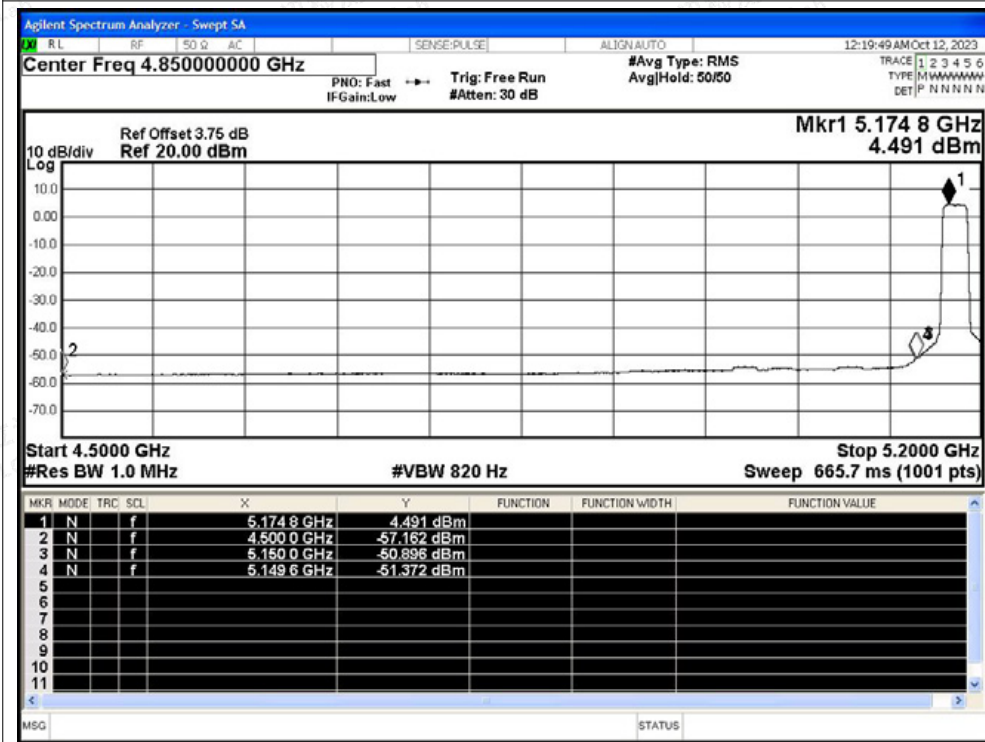




Restrict Band NVNT n20 5240MHz Ant2 Peak

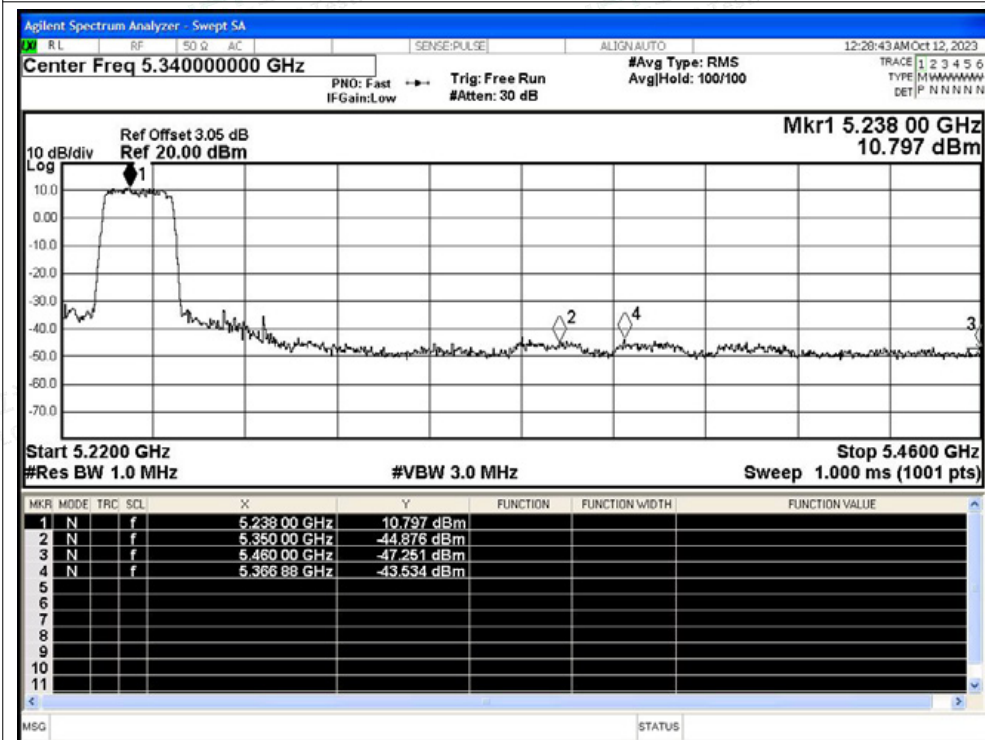

Restrict Band NVNT n20 5240MHz Ant2 Average

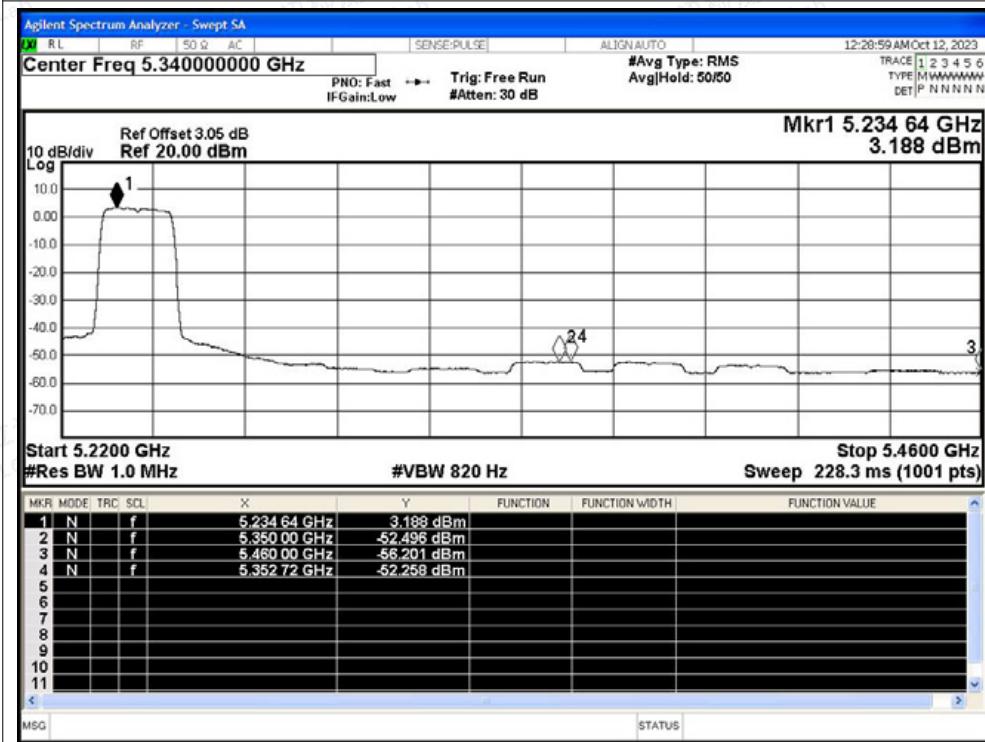

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant2 Peak

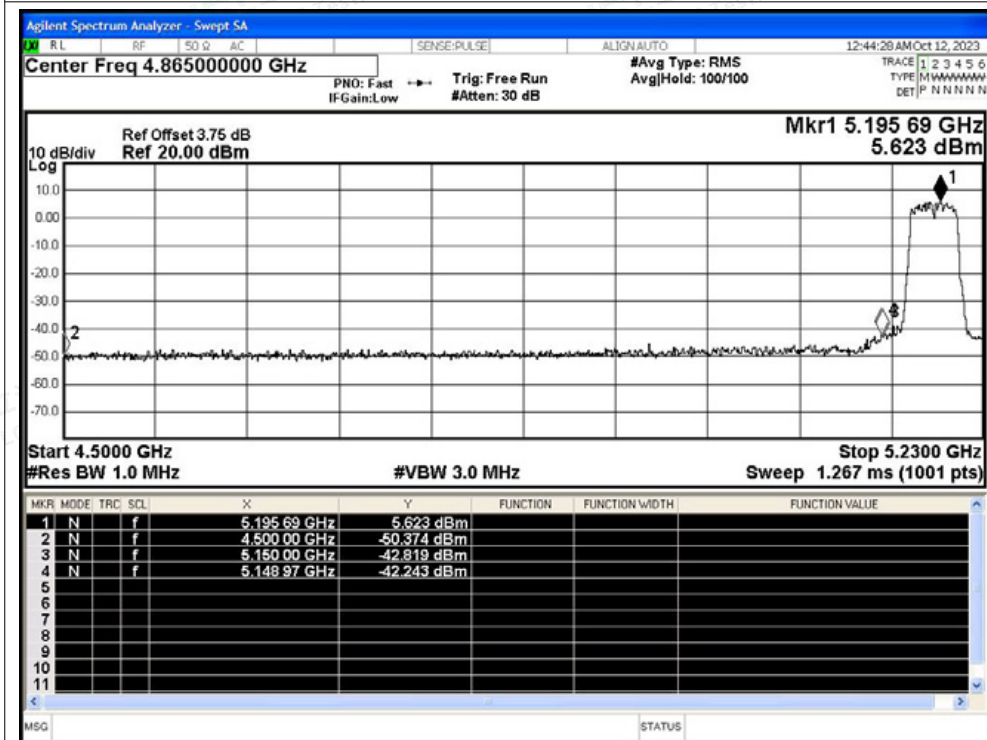


Restrict Band NVNT n40 5190MHz Ant2 Average

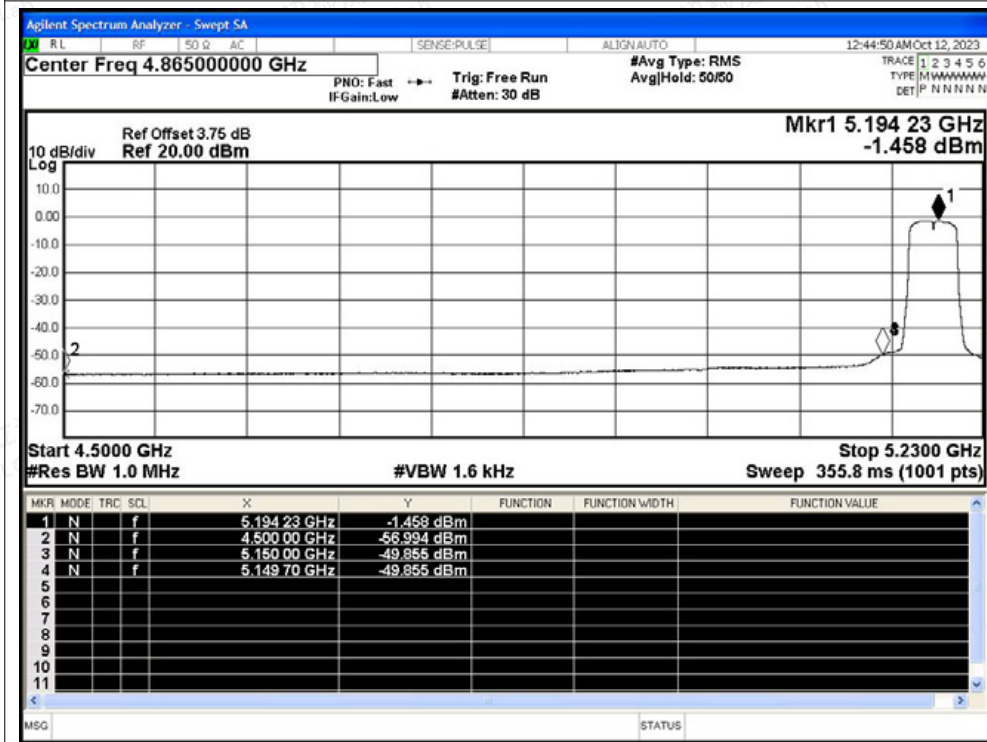




Restrict Band NVNT n40 5230MHz Ant2 Peak

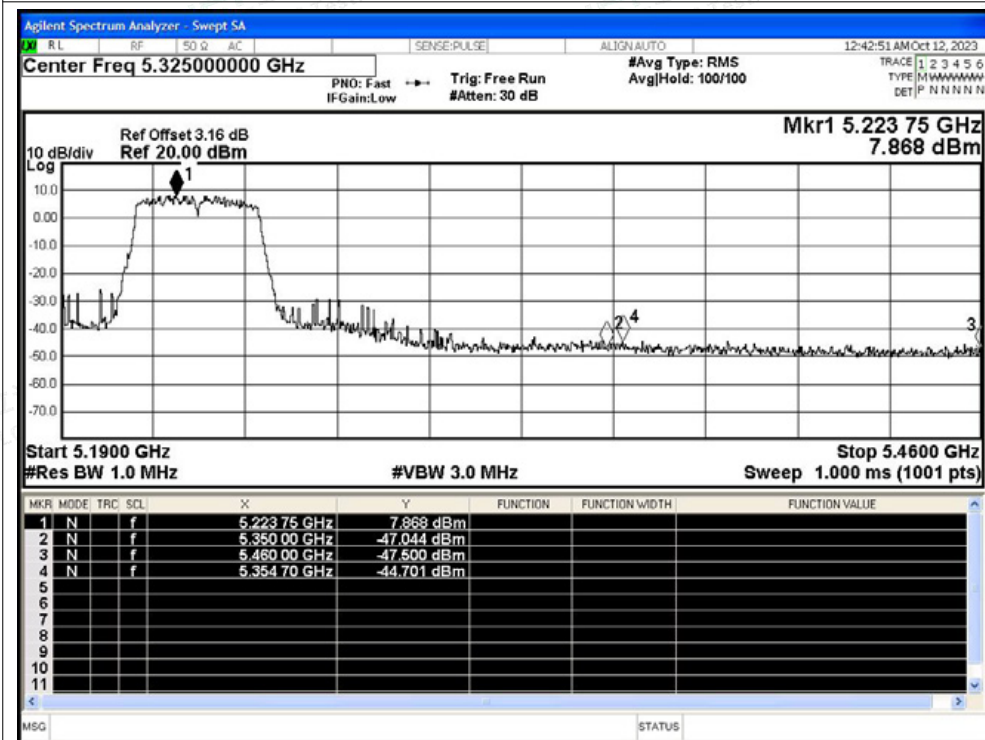

Restrict Band NVNT n40 5230MHz Ant2 Average

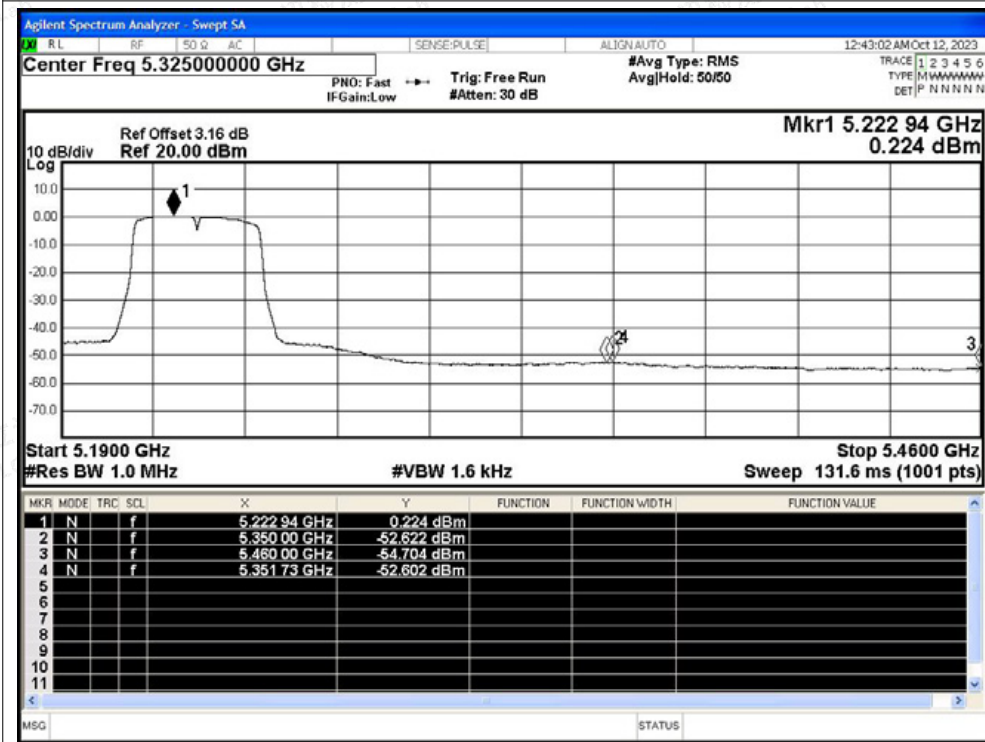

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant2 Peak

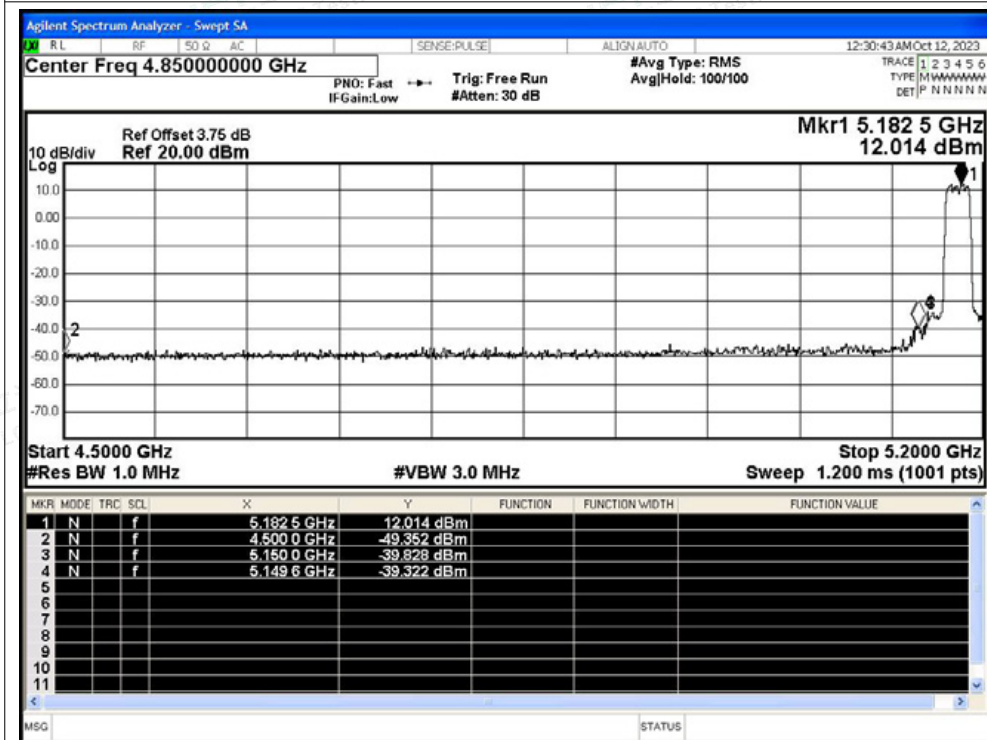


Restrict Band NVNT ac20 5180MHz Ant2 Average

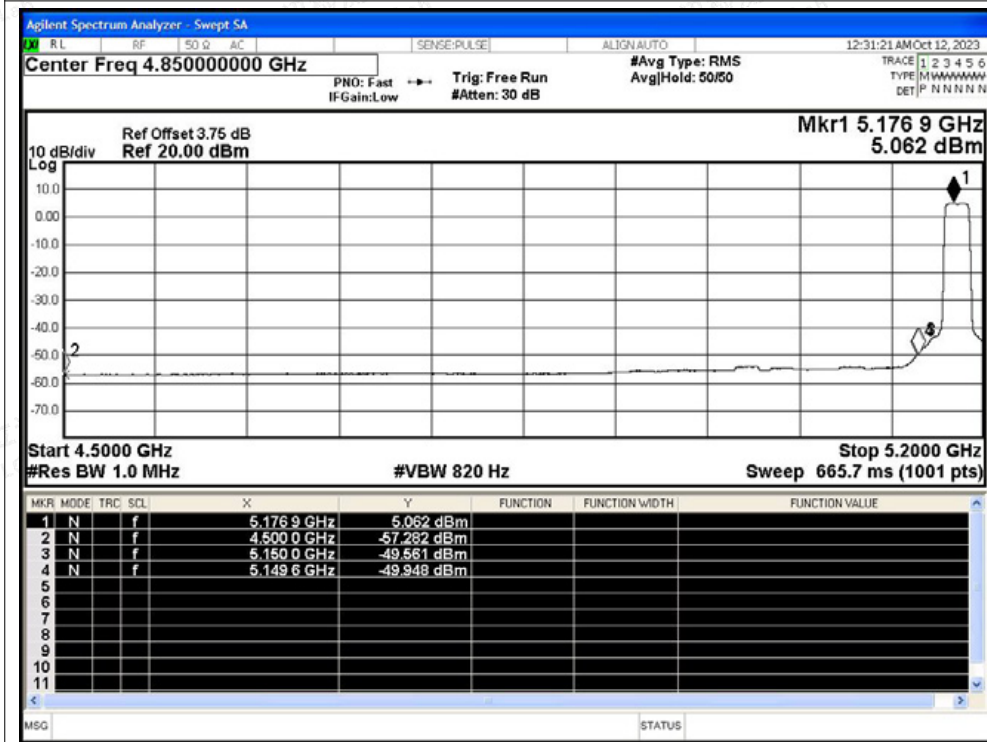




Restrict Band NVNT ac20 5240MHz Ant2 Peak

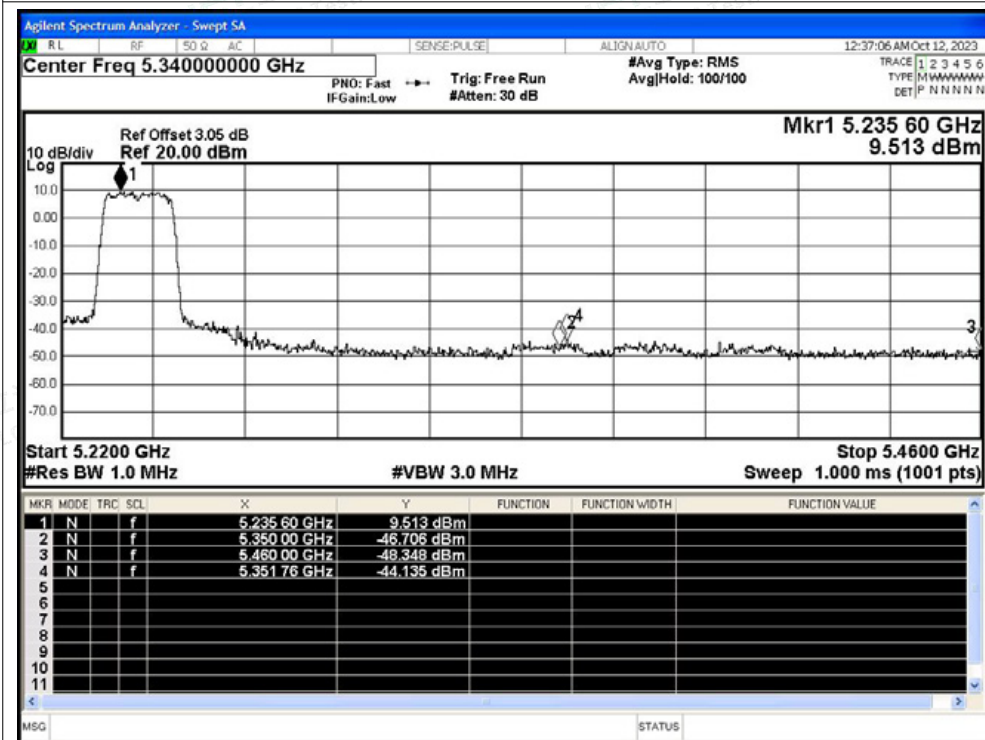


Restrict Band NVNT ac20 5240MHz Ant2 Average

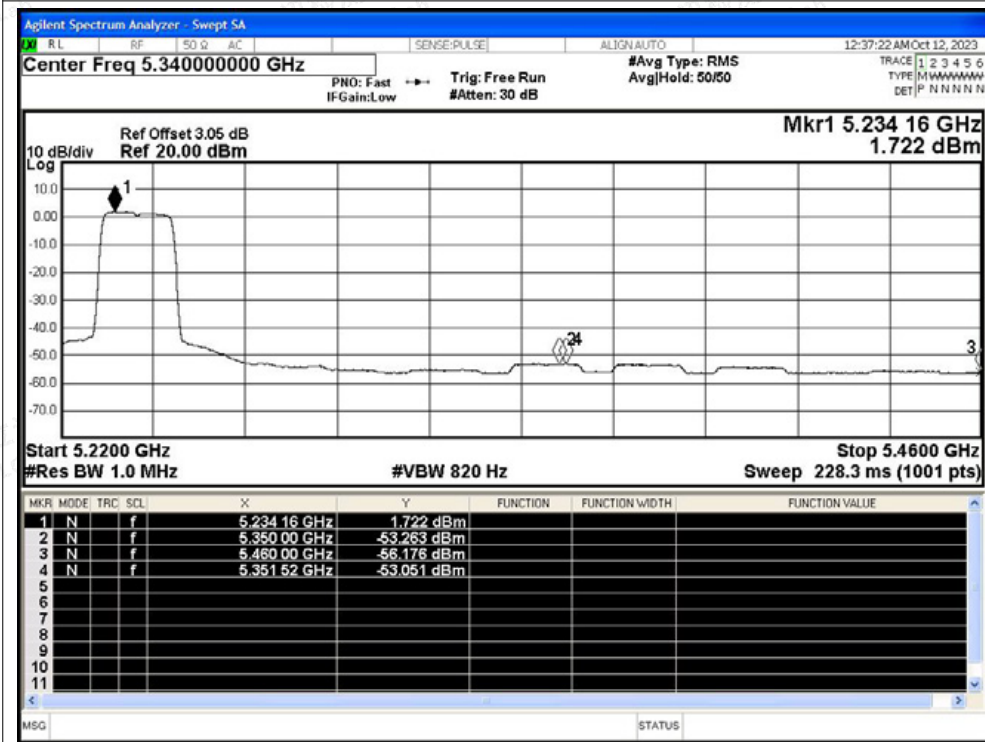




Restrict Band NVNT ac40 5190MHz Ant2 Peak

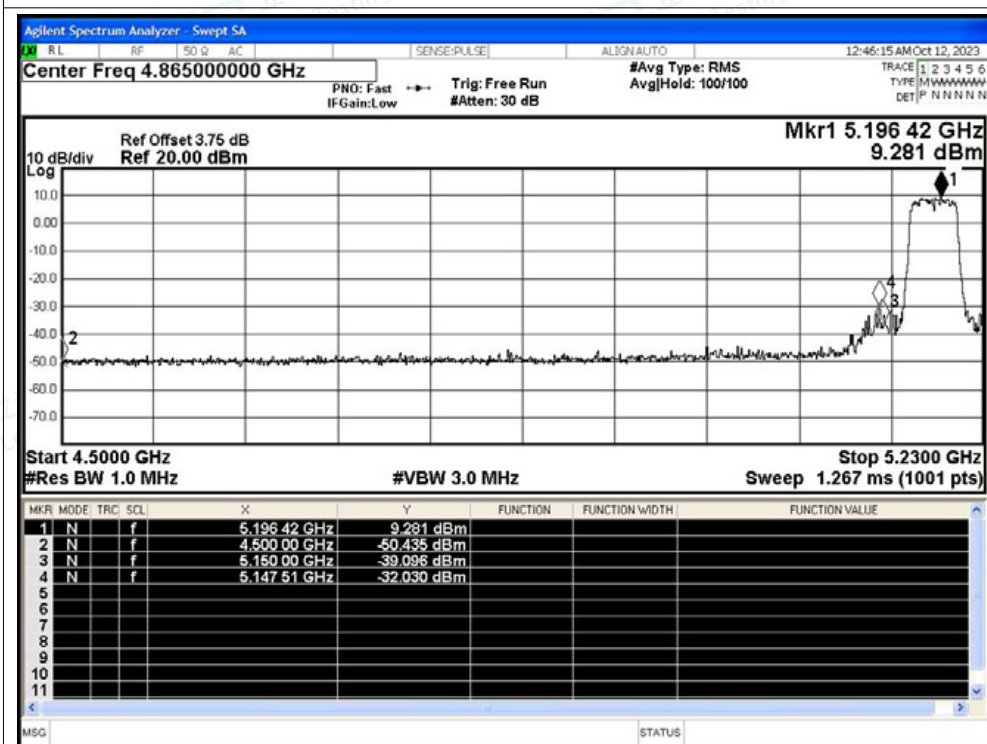


Restrict Band NVNT ac40 5190MHz Ant2 Average

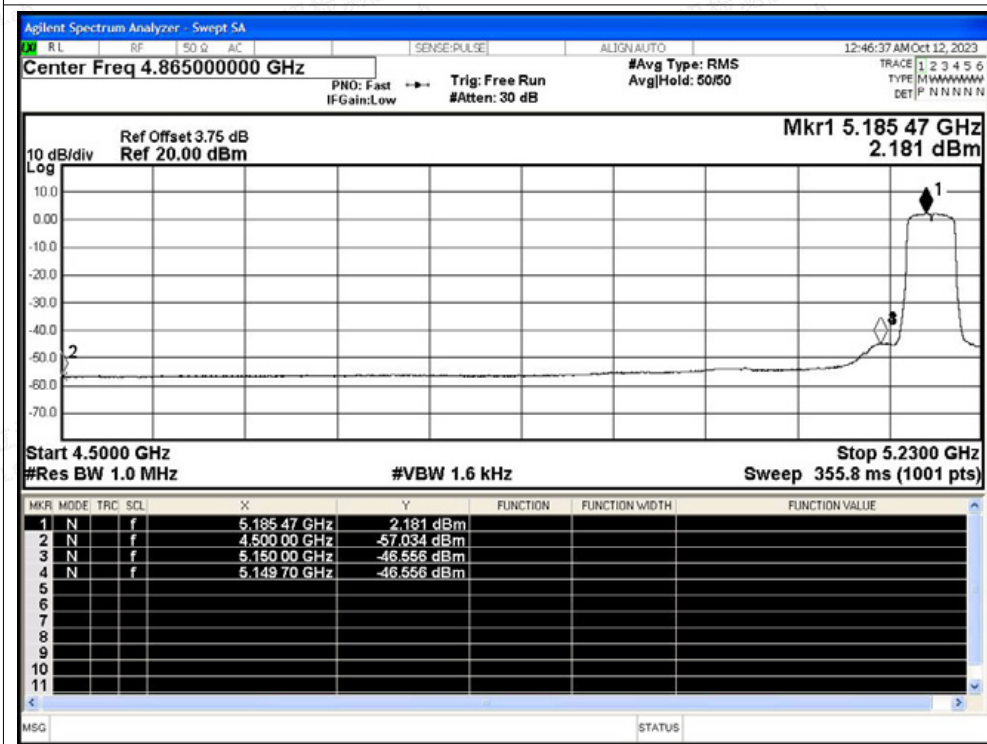




Restrict Band NVNT ac40 5230MHz Ant2 Peak

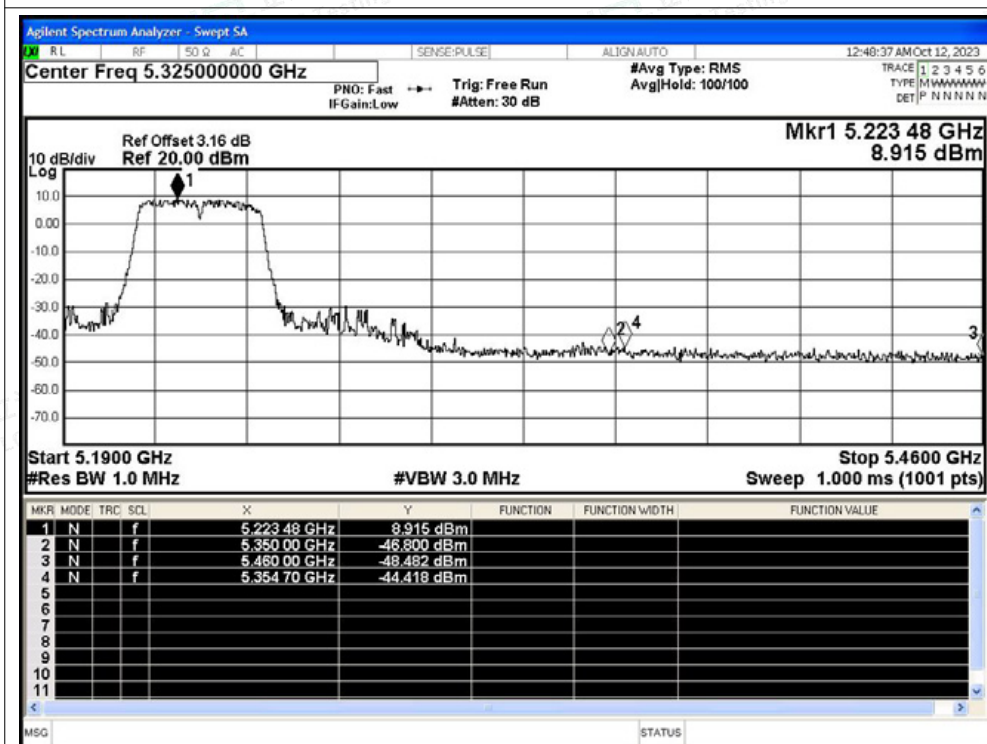

Restrict Band NVNT ac40 5230MHz Ant2 Average

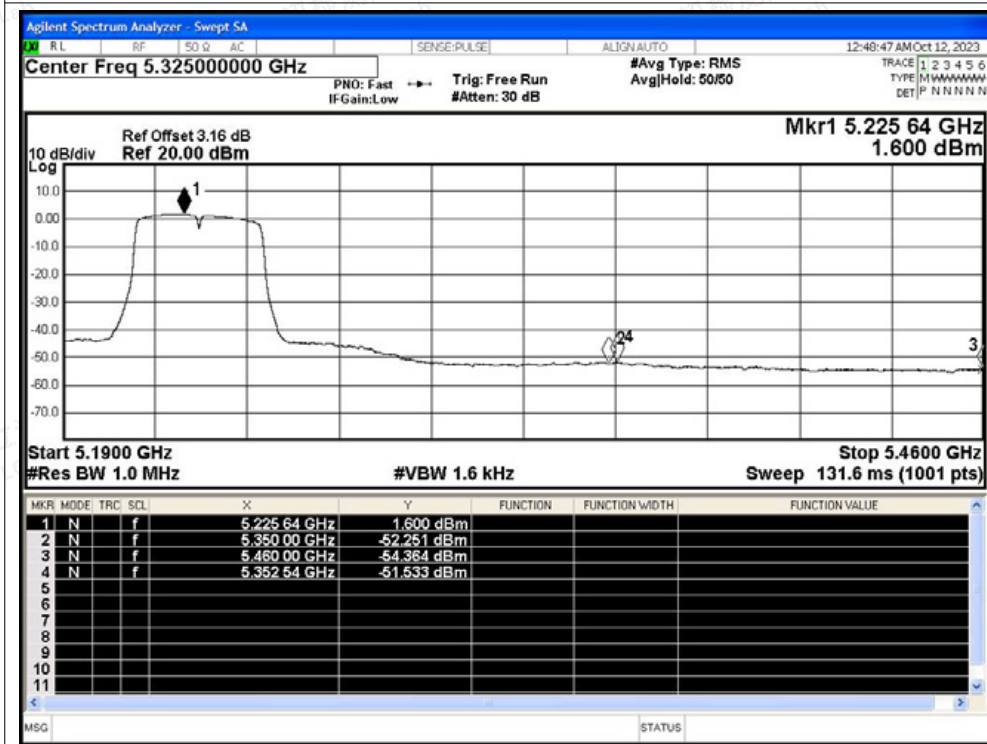

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity