

Appendix Test Data

Report No.:	1812C50440012504	Test Sample No.:	1-2-2
Start Test Date:	2025-9-2	Finish Test Date:	2025-9-18
Test Engineer:	<i>dylan. Ma</i>	Auditor:	<i>Justin Feng</i>
Temperature:	24.7°C	Relative Humidity:	60%
Pressure:	101kPa		

Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	17.52	5171.36	5188.88	---	---
11A	Ant1	5200	18.12	5190.96	5209.08	---	---
11A	Ant1	5240	18.20	5230.92	5249.12	---	---
11A	Ant1	5745	17.96	5736.00	5753.96	---	---
11A	Ant1	5785	18.28	5775.92	5794.20	---	---
11A	Ant1	5825	18.12	5815.96	5834.08	---	---
11N20SISO	Ant1	5180	18.64	5170.72	5189.36	---	---
11N20SISO	Ant1	5200	18.68	5190.68	5209.36	---	---
11N20SISO	Ant1	5240	18.76	5230.64	5249.40	---	---
11N20SISO	Ant1	5745	18.68	5735.68	5754.36	---	---
11N20SISO	Ant1	5785	18.72	5775.68	5794.40	---	---
11N20SISO	Ant1	5825	18.68	5815.68	5834.36	---	---
11N40SISO	Ant1	5190	38.32	5170.80	5209.12	---	---
11N40SISO	Ant1	5230	38.32	5210.80	5249.12	---	---
11N40SISO	Ant1	5755	38.16	5735.72	5773.88	---	---
11N40SISO	Ant1	5795	38.40	5775.72	5814.12	---	---
11AC20SISO	Ant1	5180	19.12	5170.44	5189.56	---	---
11AC20SISO	Ant1	5200	19.00	5190.52	5209.52	---	---
11AC20SISO	Ant1	5240	19.28	5230.32	5249.60	---	---
11AC20SISO	Ant1	5745	19.20	5735.32	5754.52	---	---
11AC20SISO	Ant1	5785	19.20	5775.28	5794.48	---	---
11AC20SISO	Ant1	5825	19.16	5815.40	5834.56	---	---
11AC40SISO	Ant1	5190	38.80	5170.72	5209.52	---	---
11AC40SISO	Ant1	5230	38.24	5210.80	5249.04	---	---
11AC40SISO	Ant1	5755	38.80	5735.64	5774.44	---	---


11AC40SISO	Ant1	5795	38.32	5775.80	5814.12	---	---
11AX20SISO	Ant1	5180	20.00	5169.96	5189.96	---	---
11AX20SISO	Ant1	5200	20.00	5190.04	5210.04	---	---
11AX20SISO	Ant1	5240	19.96	5230.00	5249.96	---	---
11AX20SISO	Ant1	5745	19.92	5734.96	5754.88	---	---
11AX20SISO	Ant1	5785	20.12	5774.92	5795.04	---	---
11AX20SISO	Ant1	5825	20.12	5814.88	5835.00	---	---
11AX40SISO	Ant1	5190	39.44	5170.24	5209.68	---	---
11AX40SISO	Ant1	5230	39.68	5210.16	5249.84	---	---
11AX40SISO	Ant1	5755	39.44	5735.24	5774.68	---	---
11AX40SISO	Ant1	5795	39.60	5775.24	5814.84	---	---


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

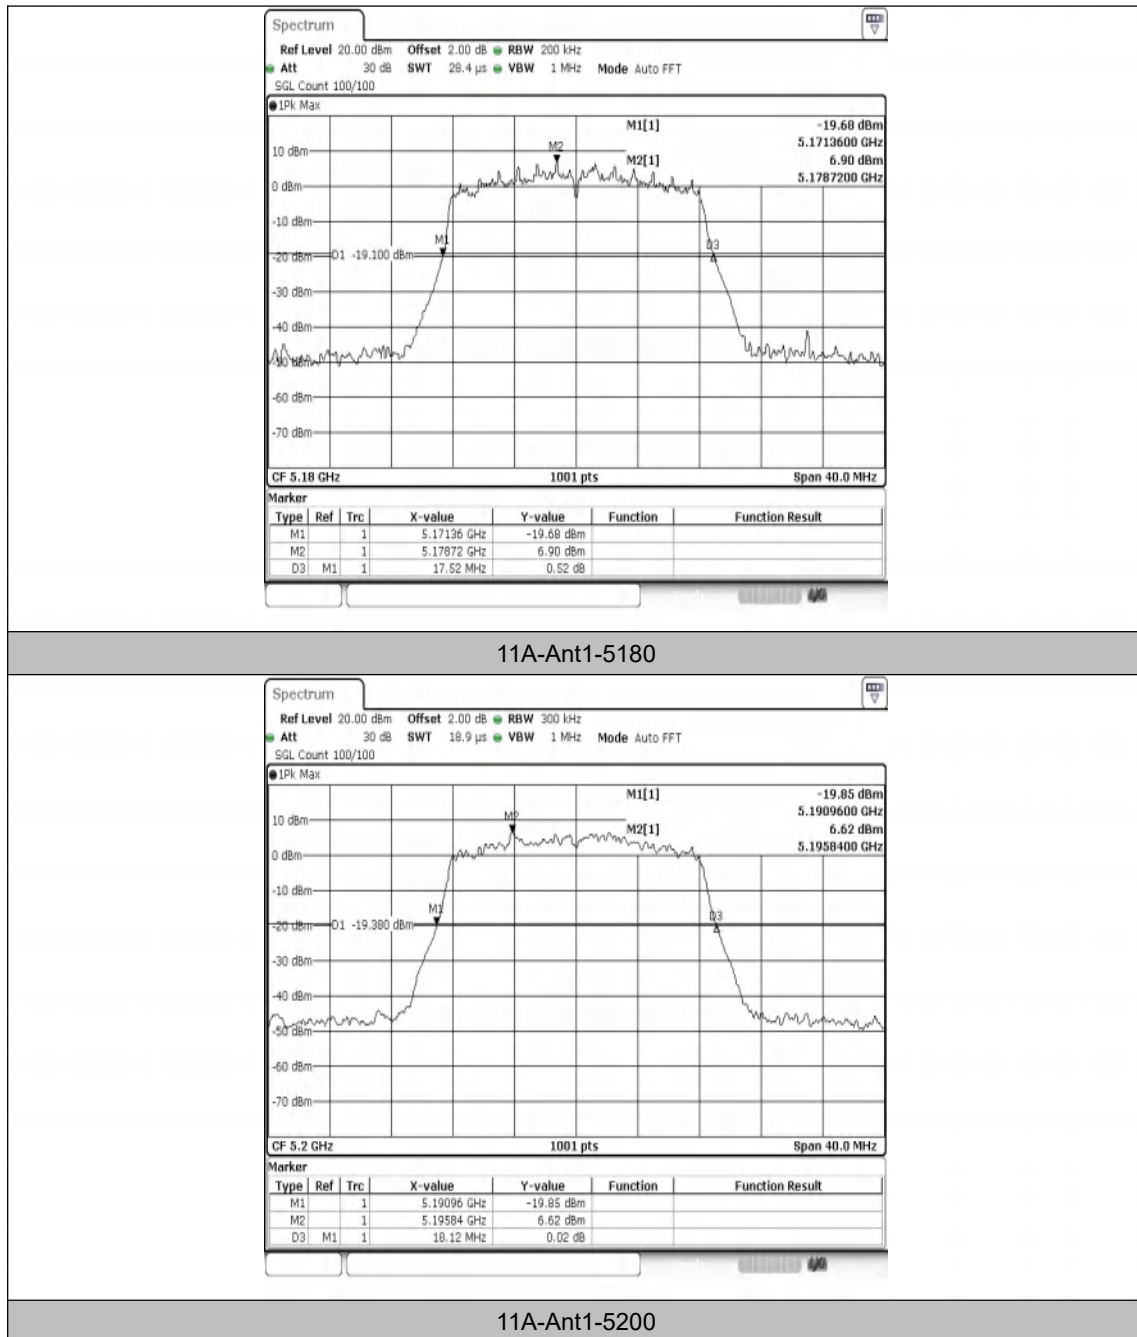


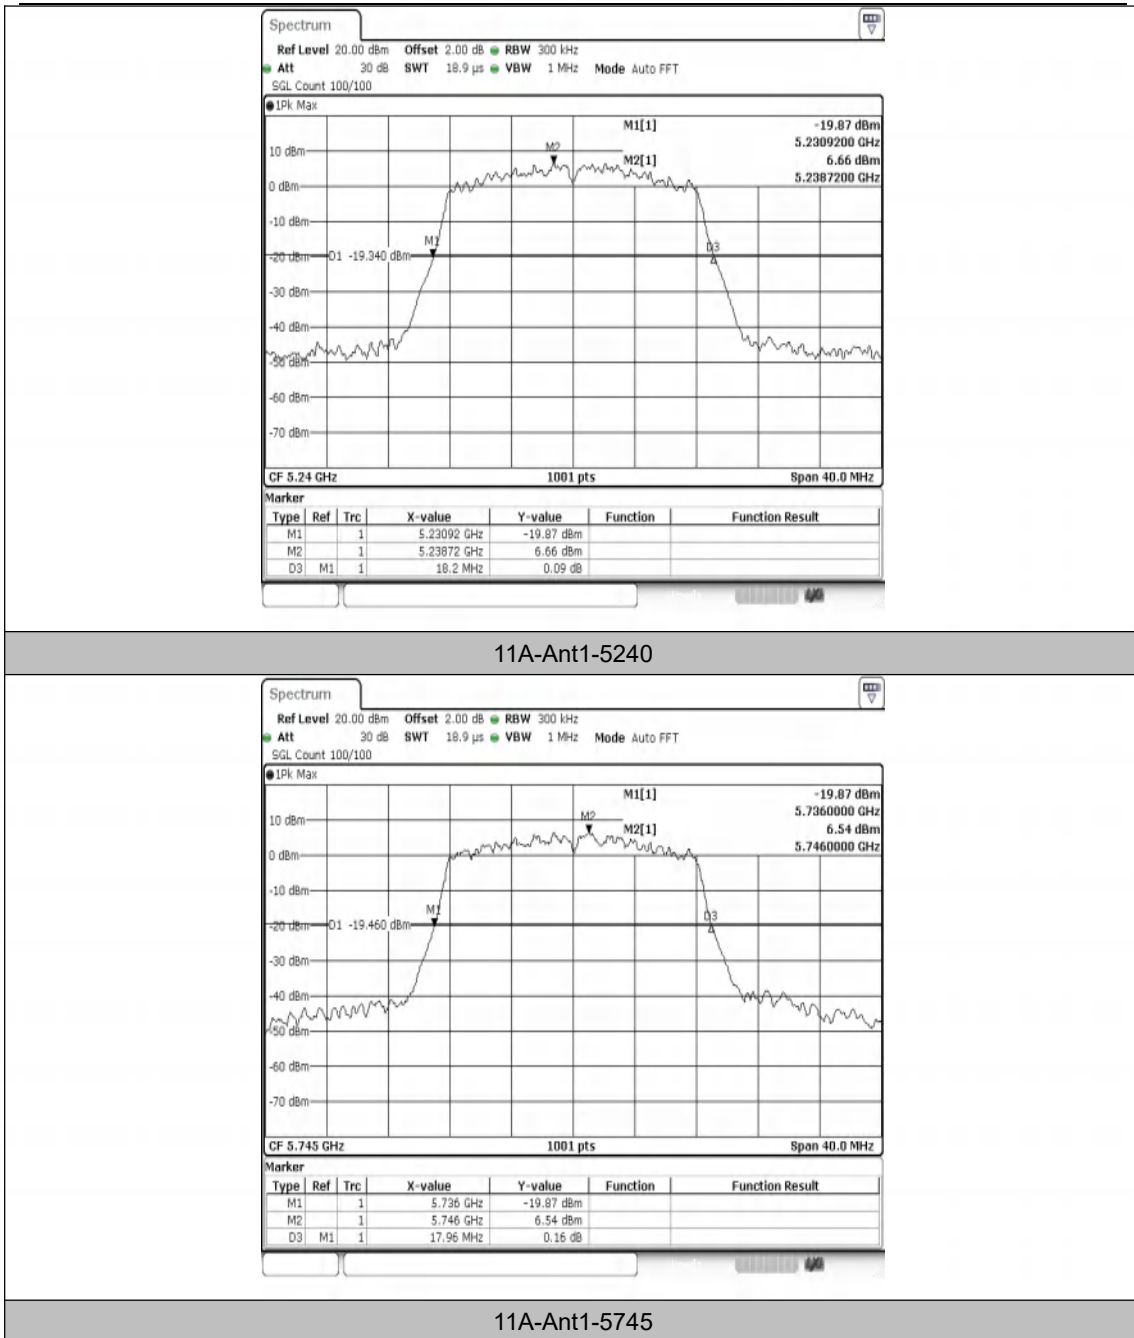


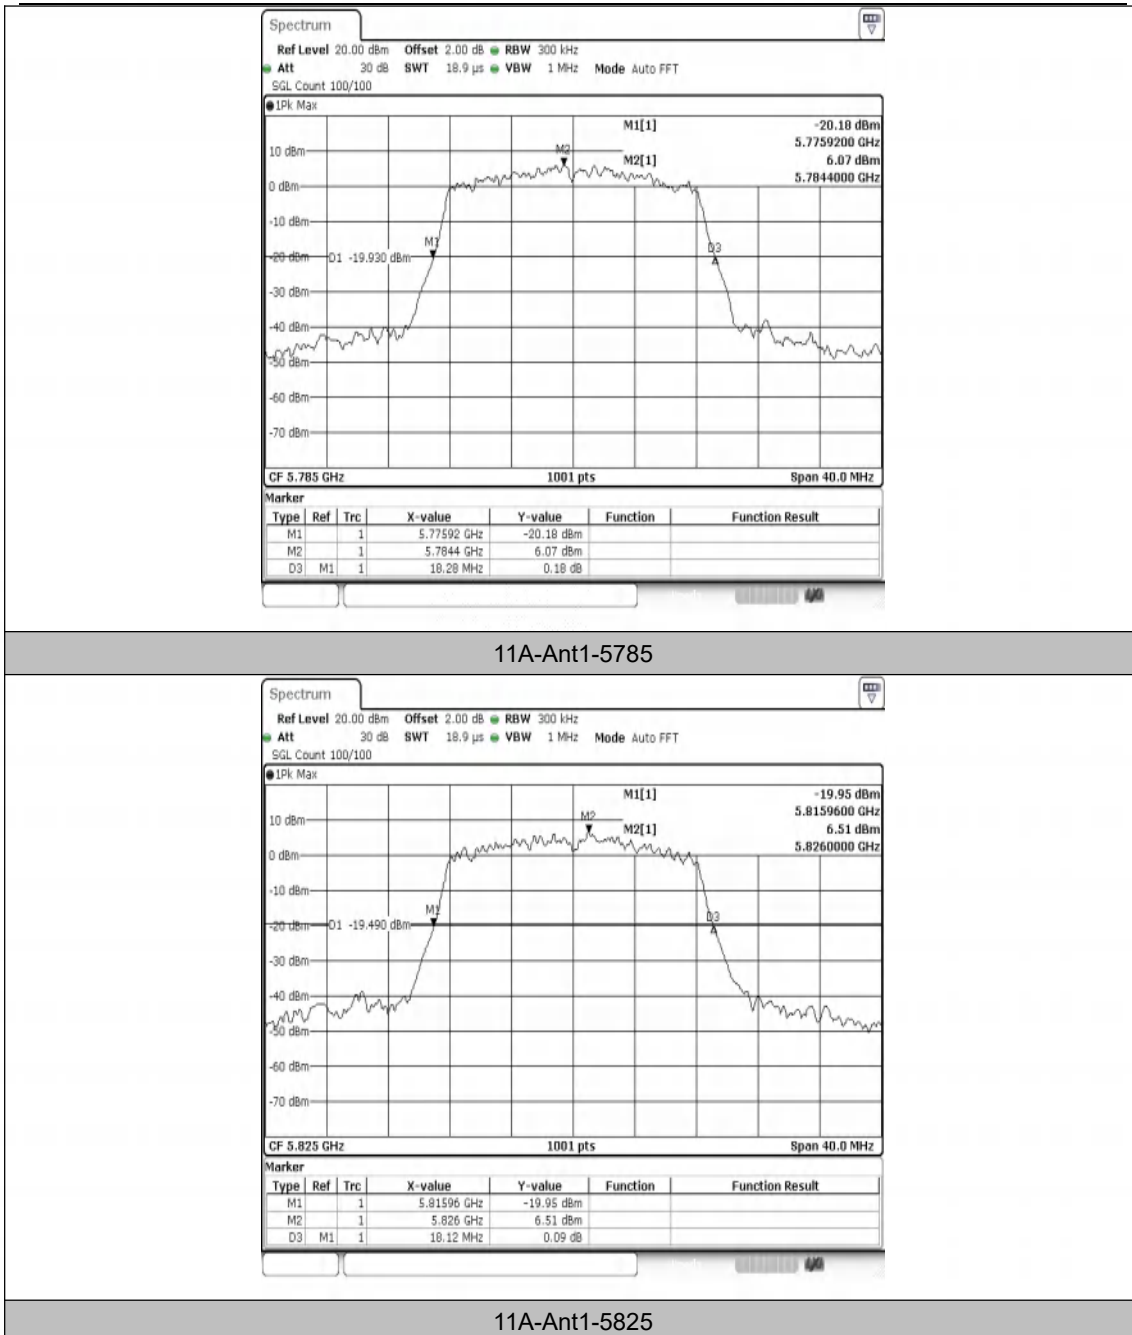


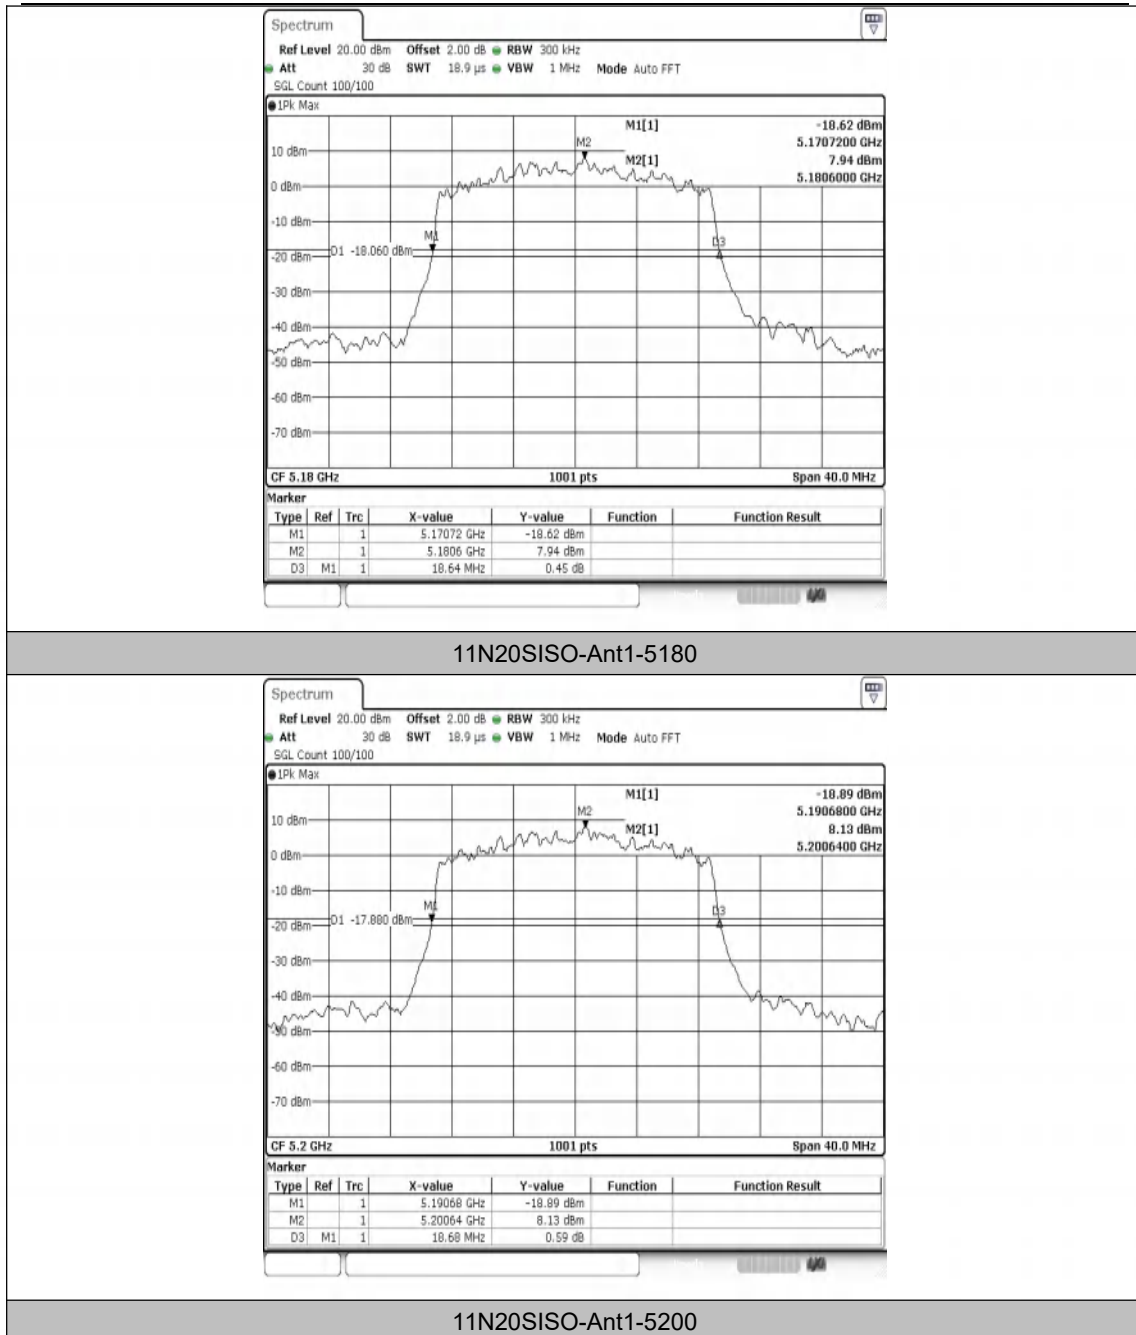


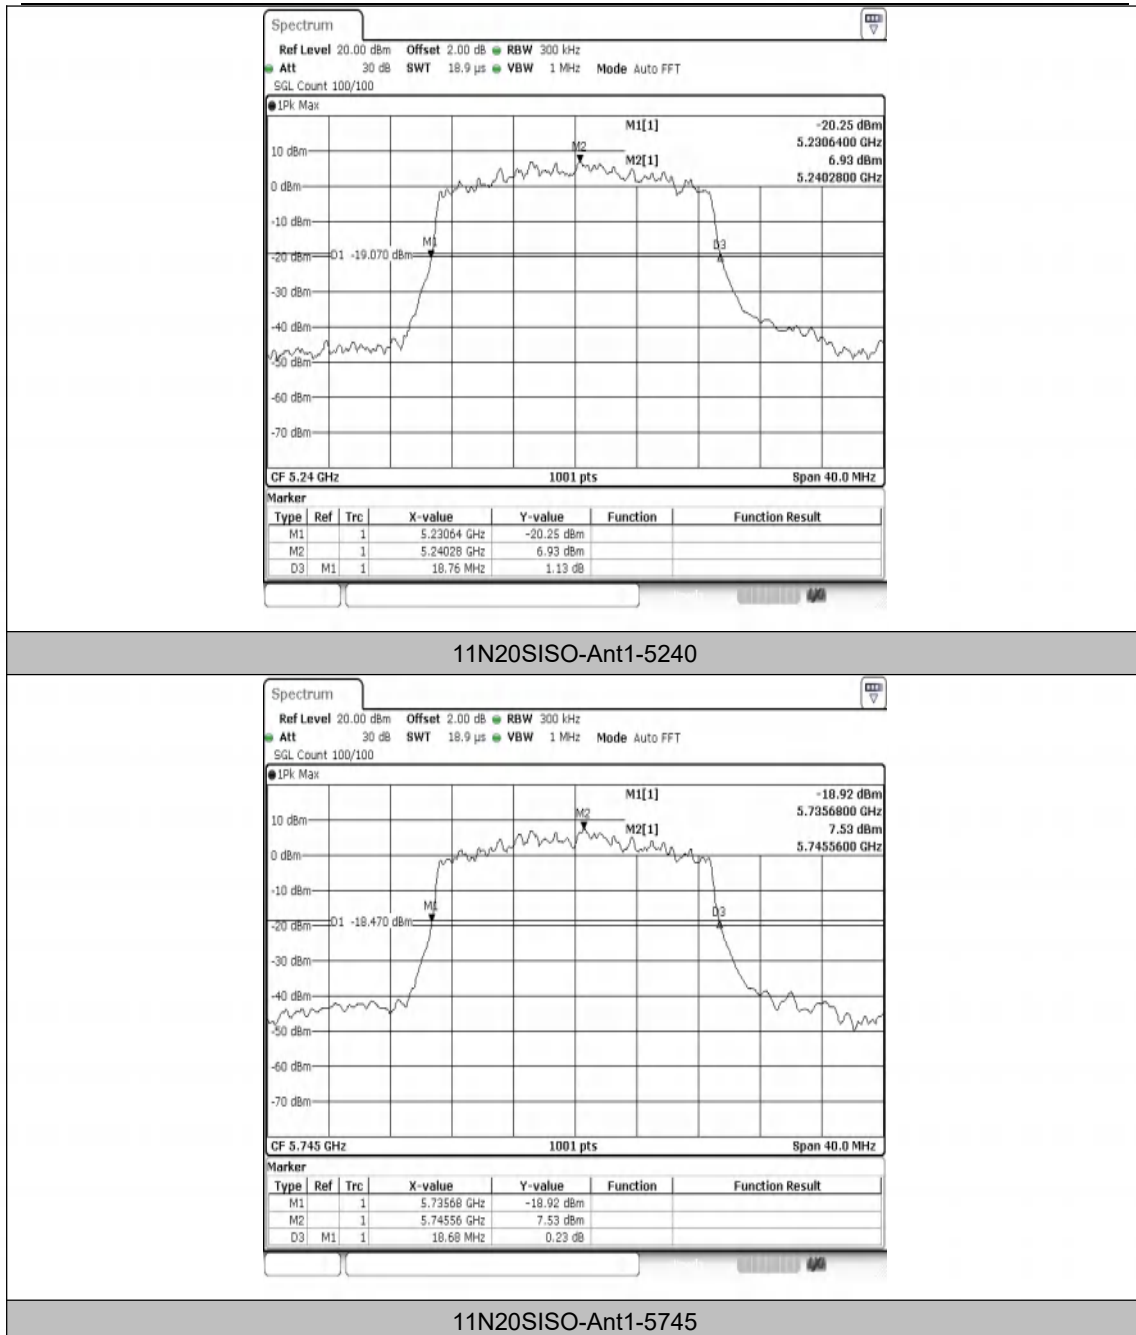


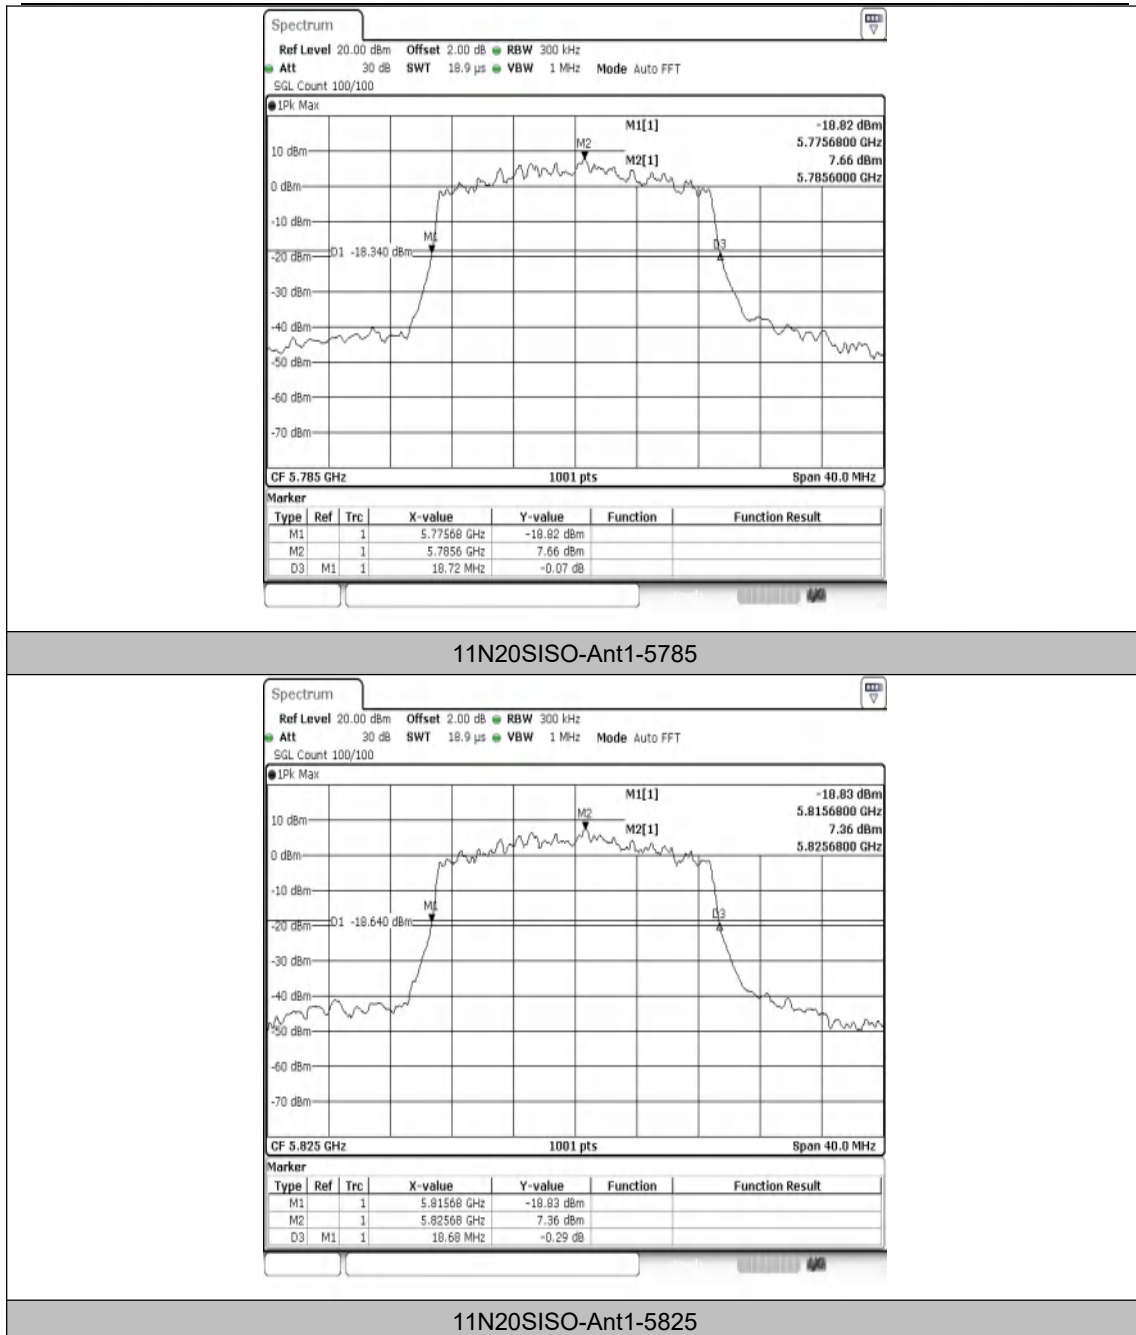


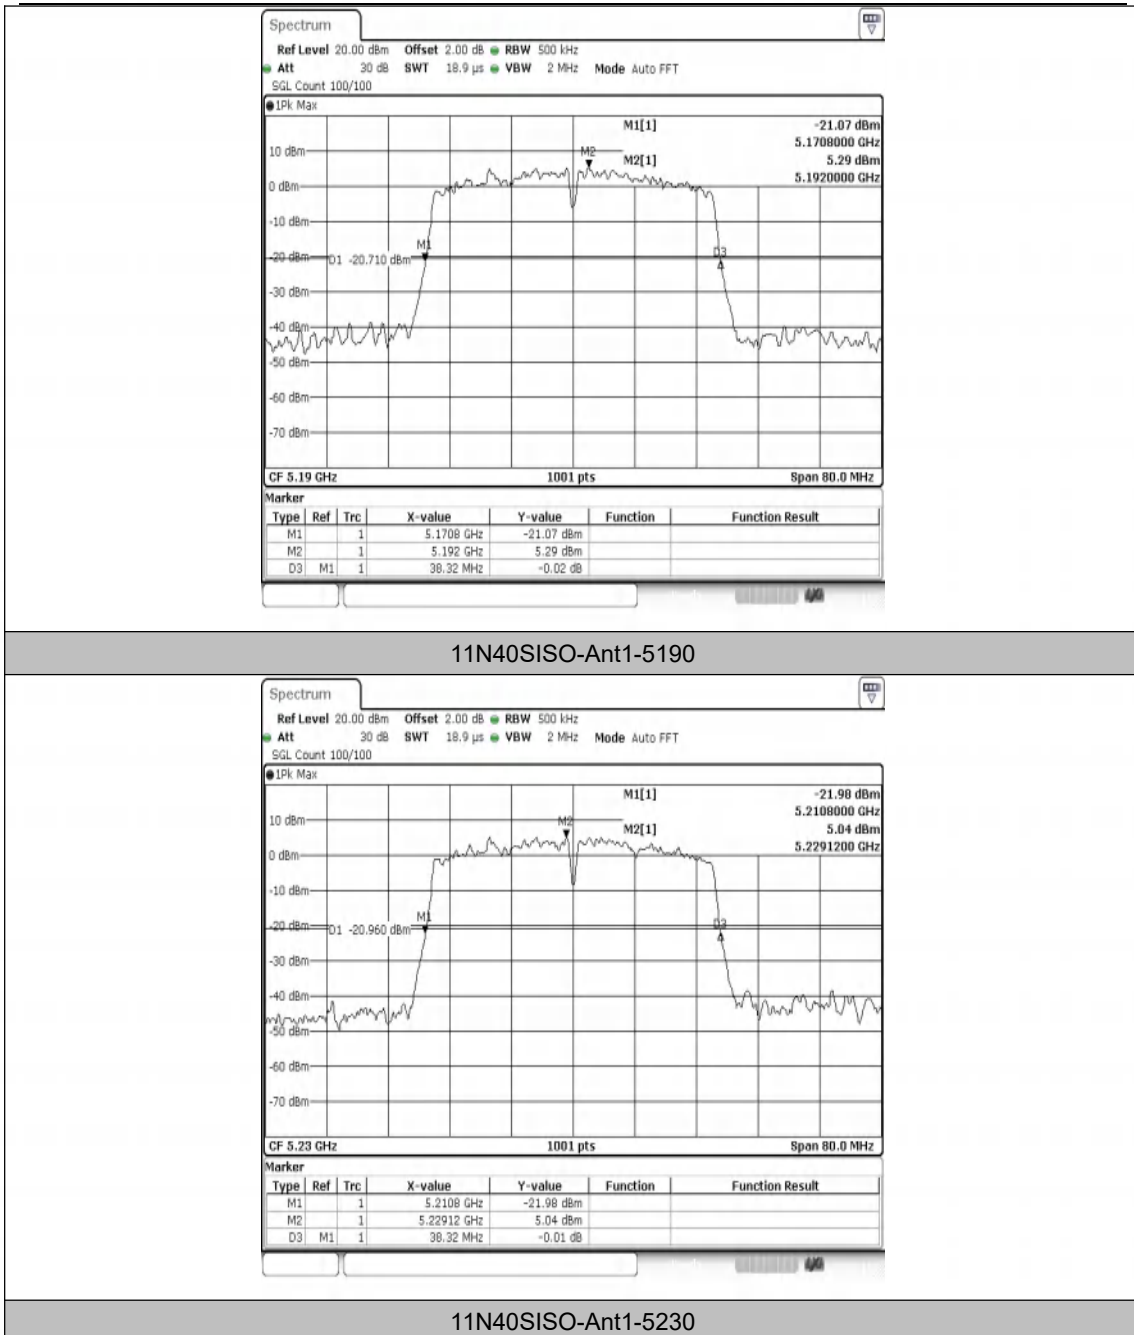


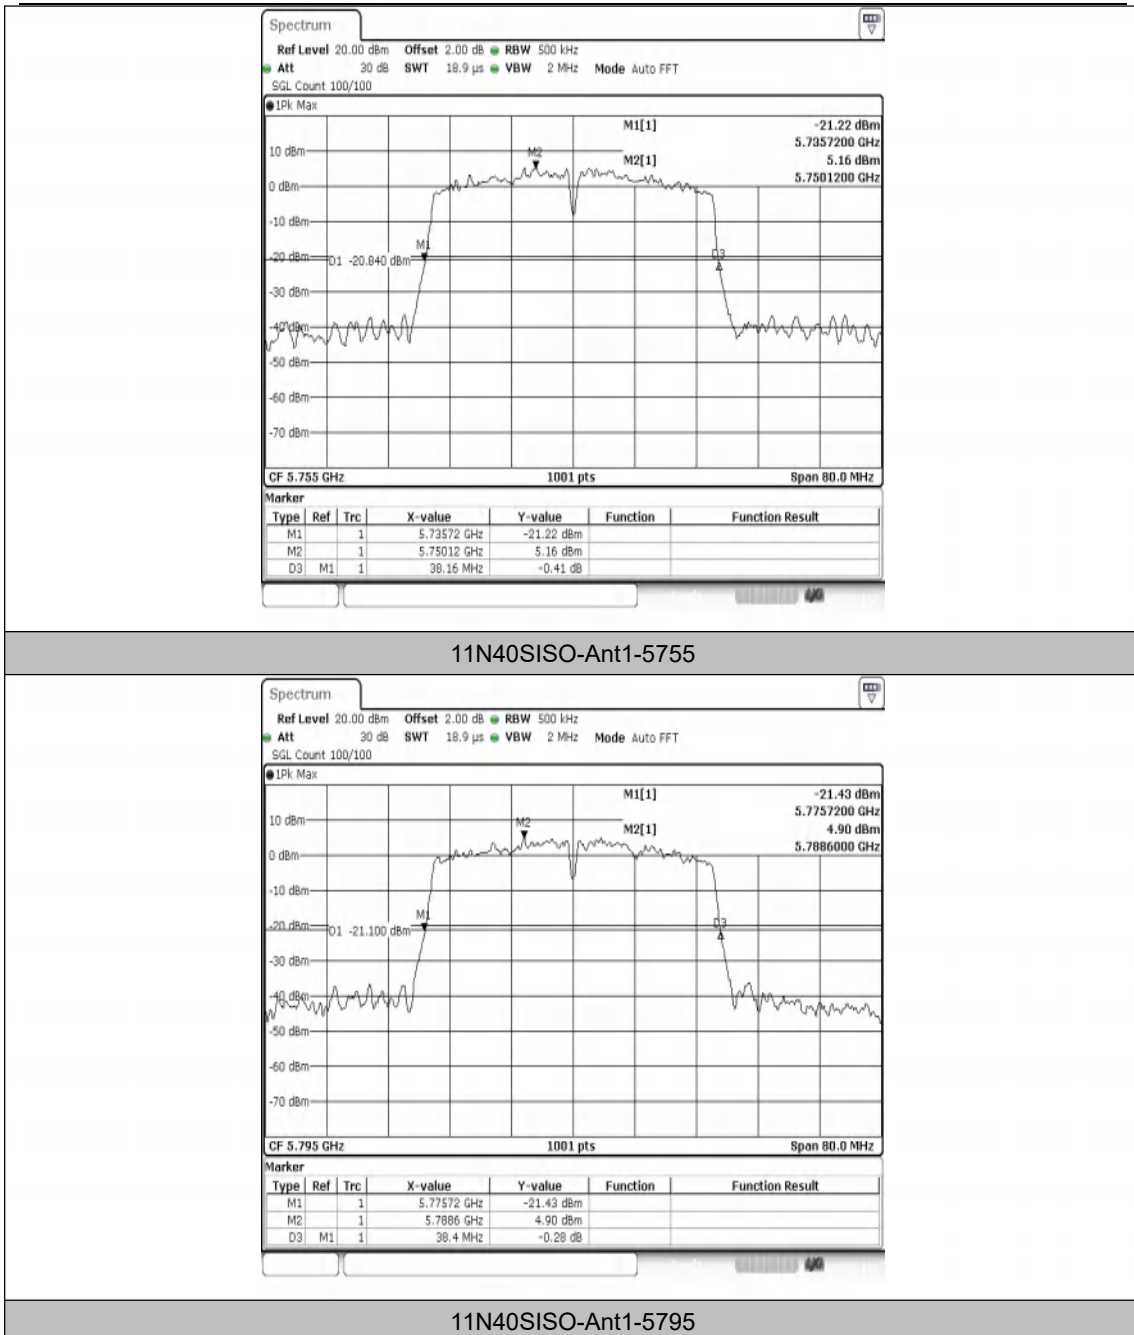


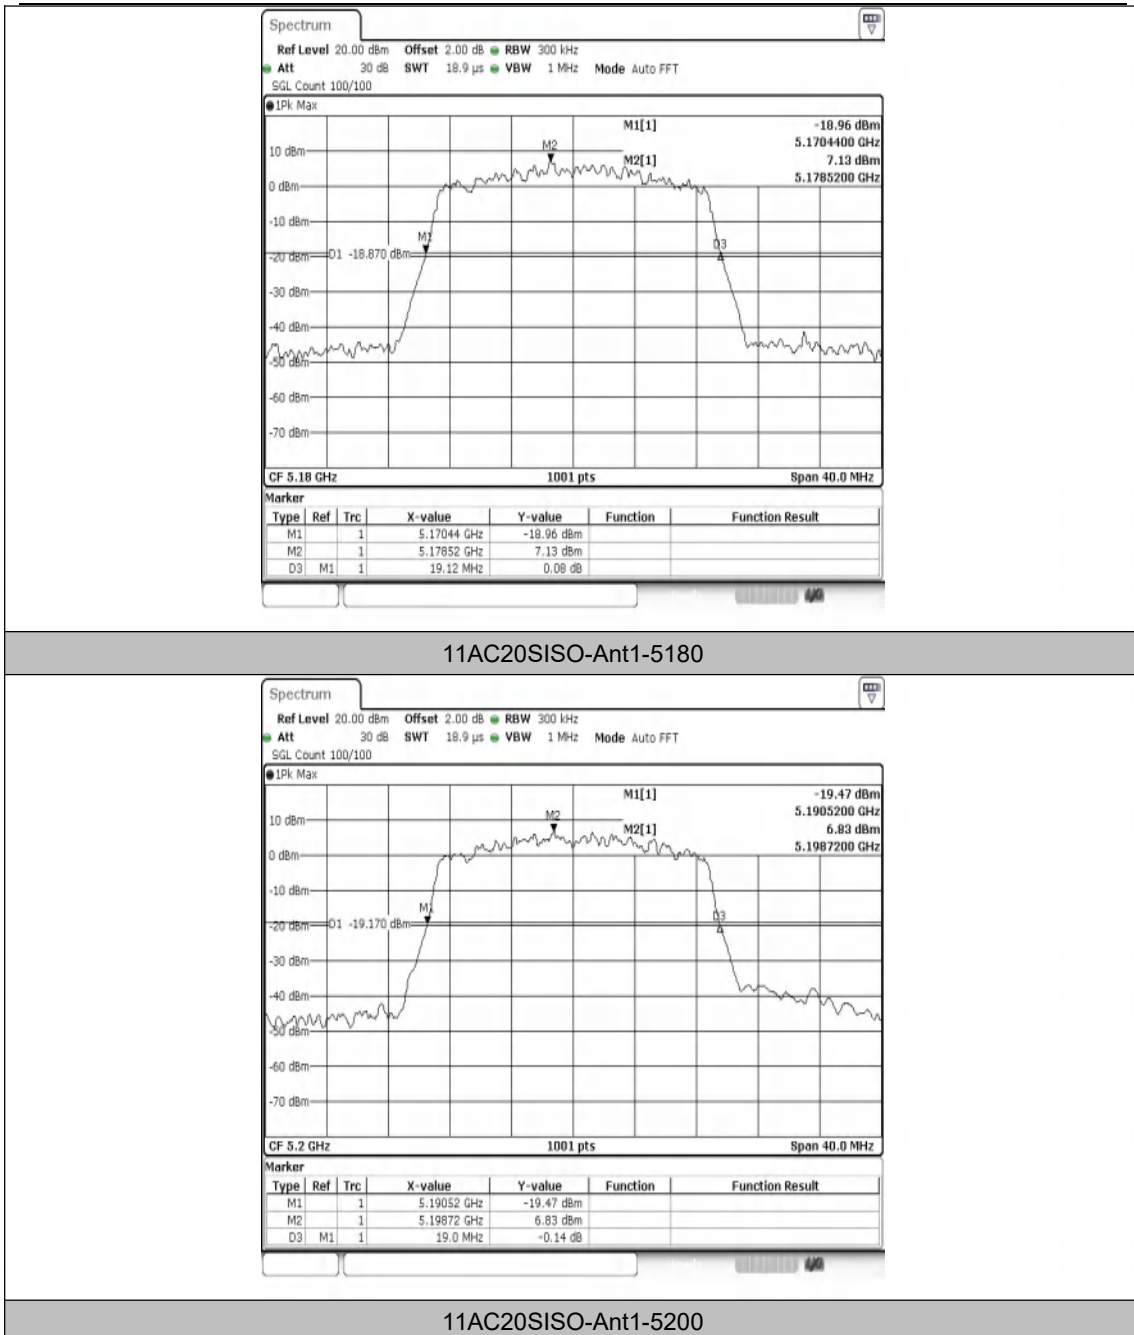


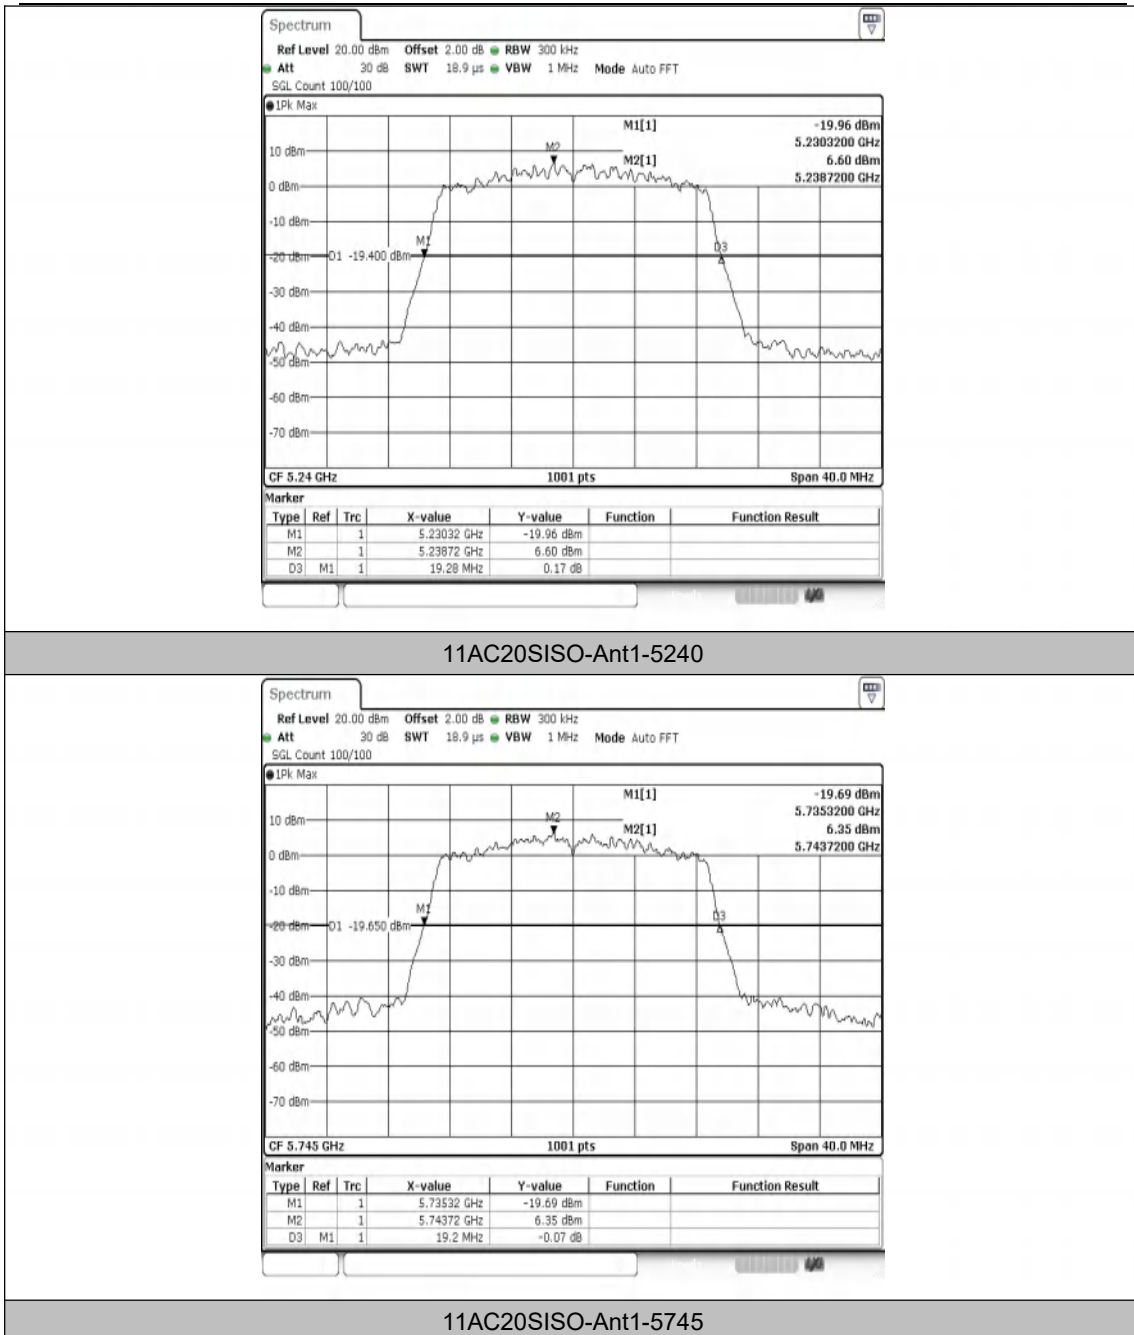


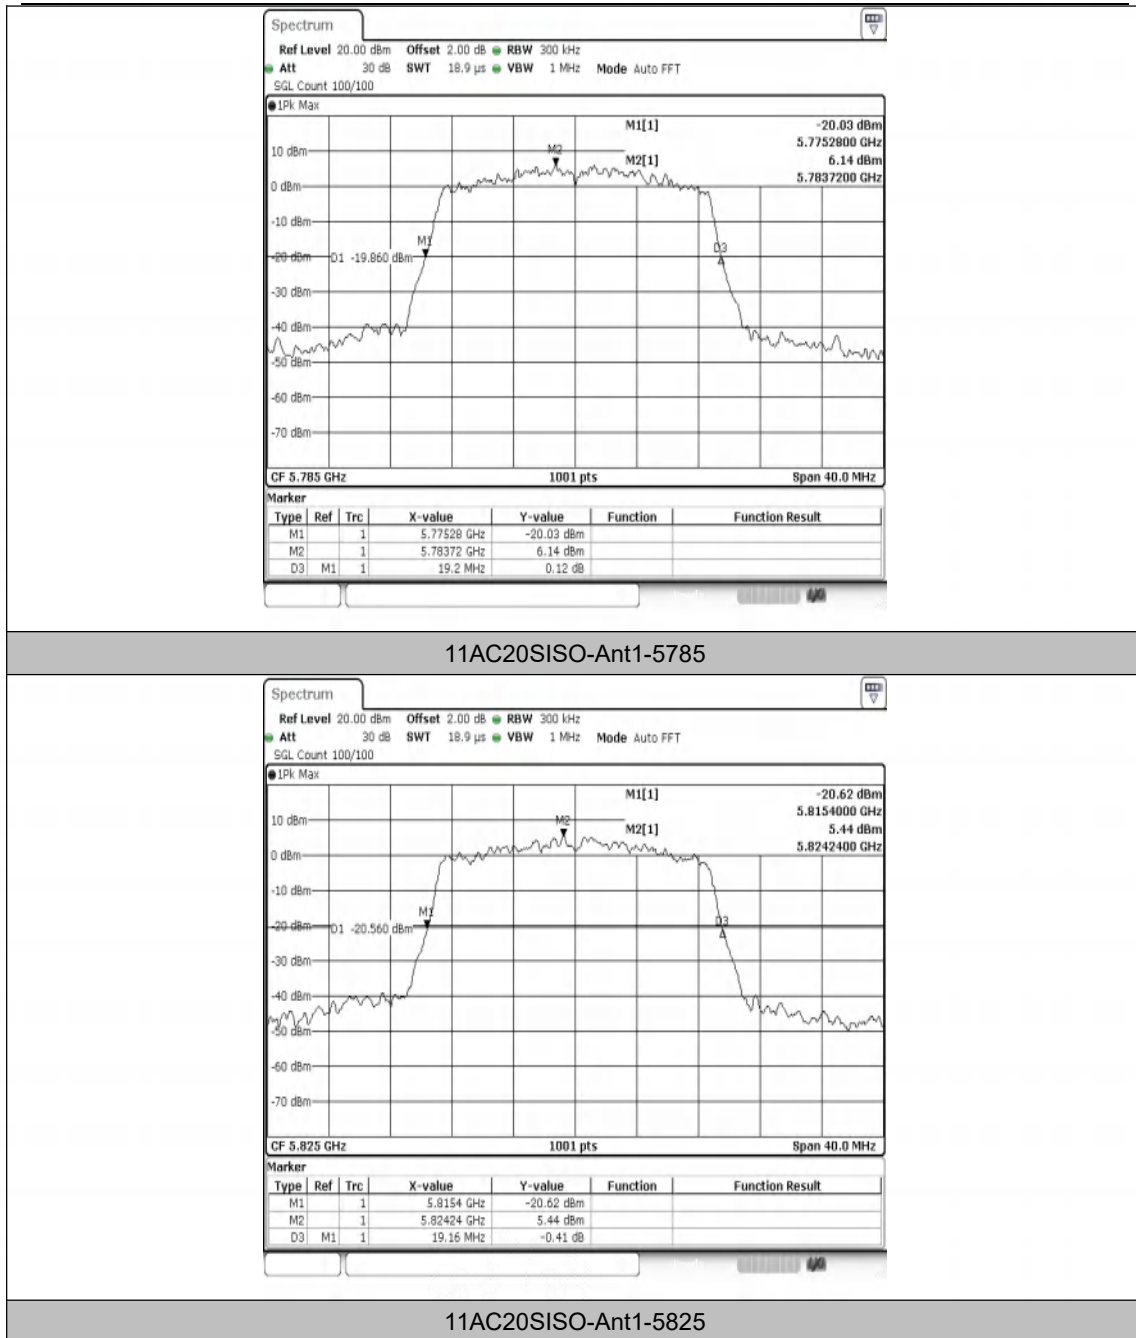


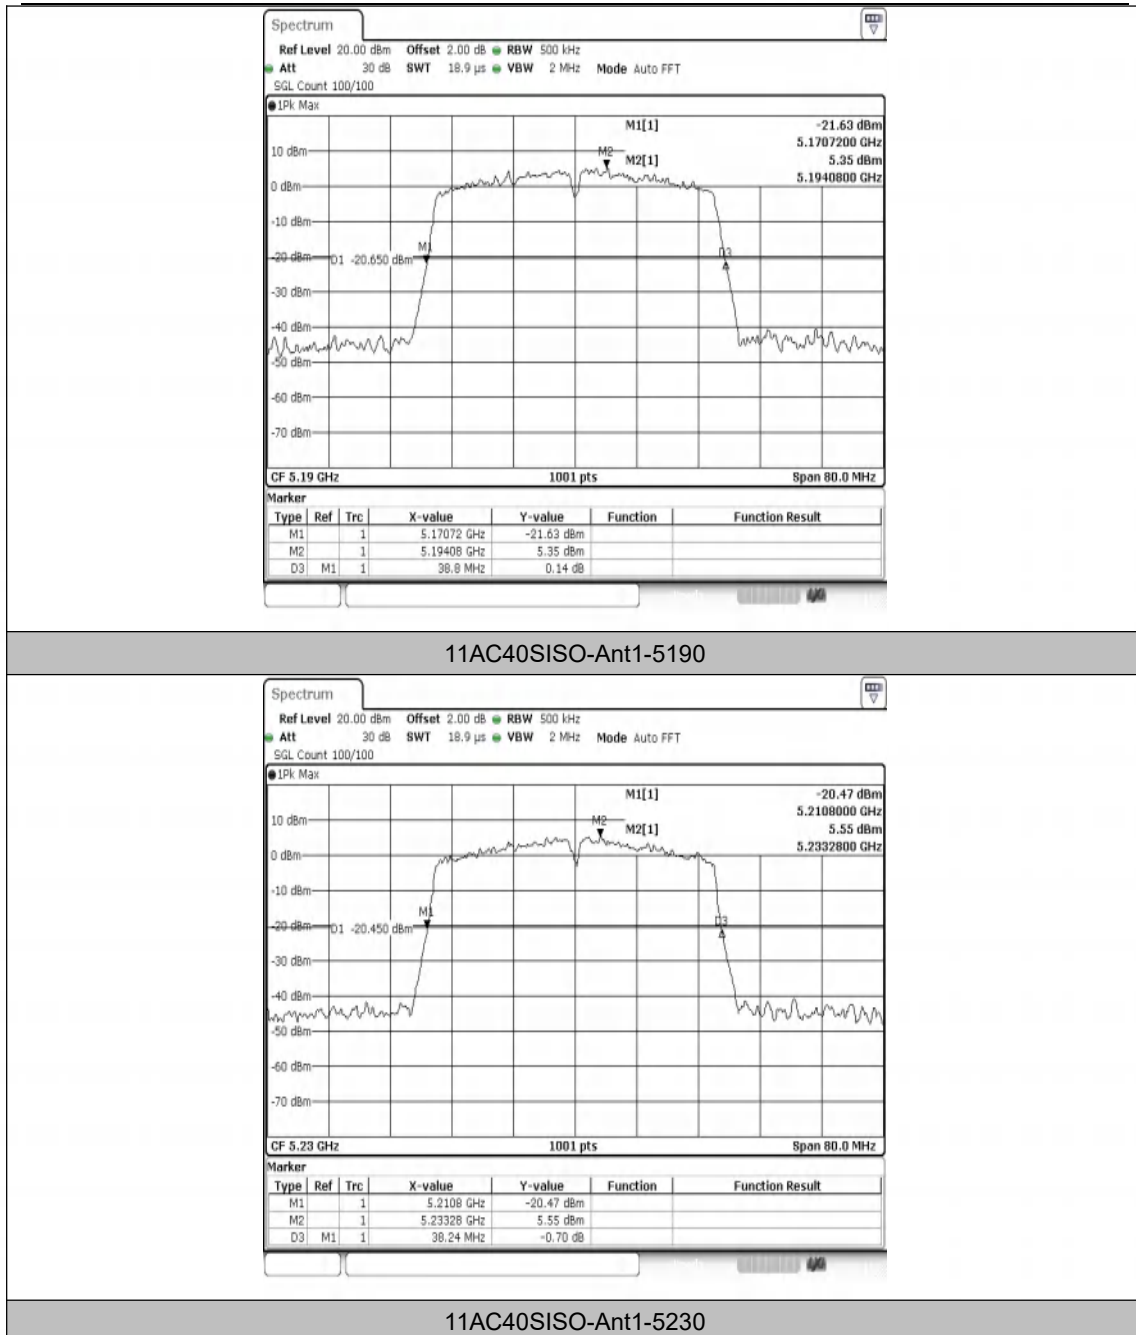


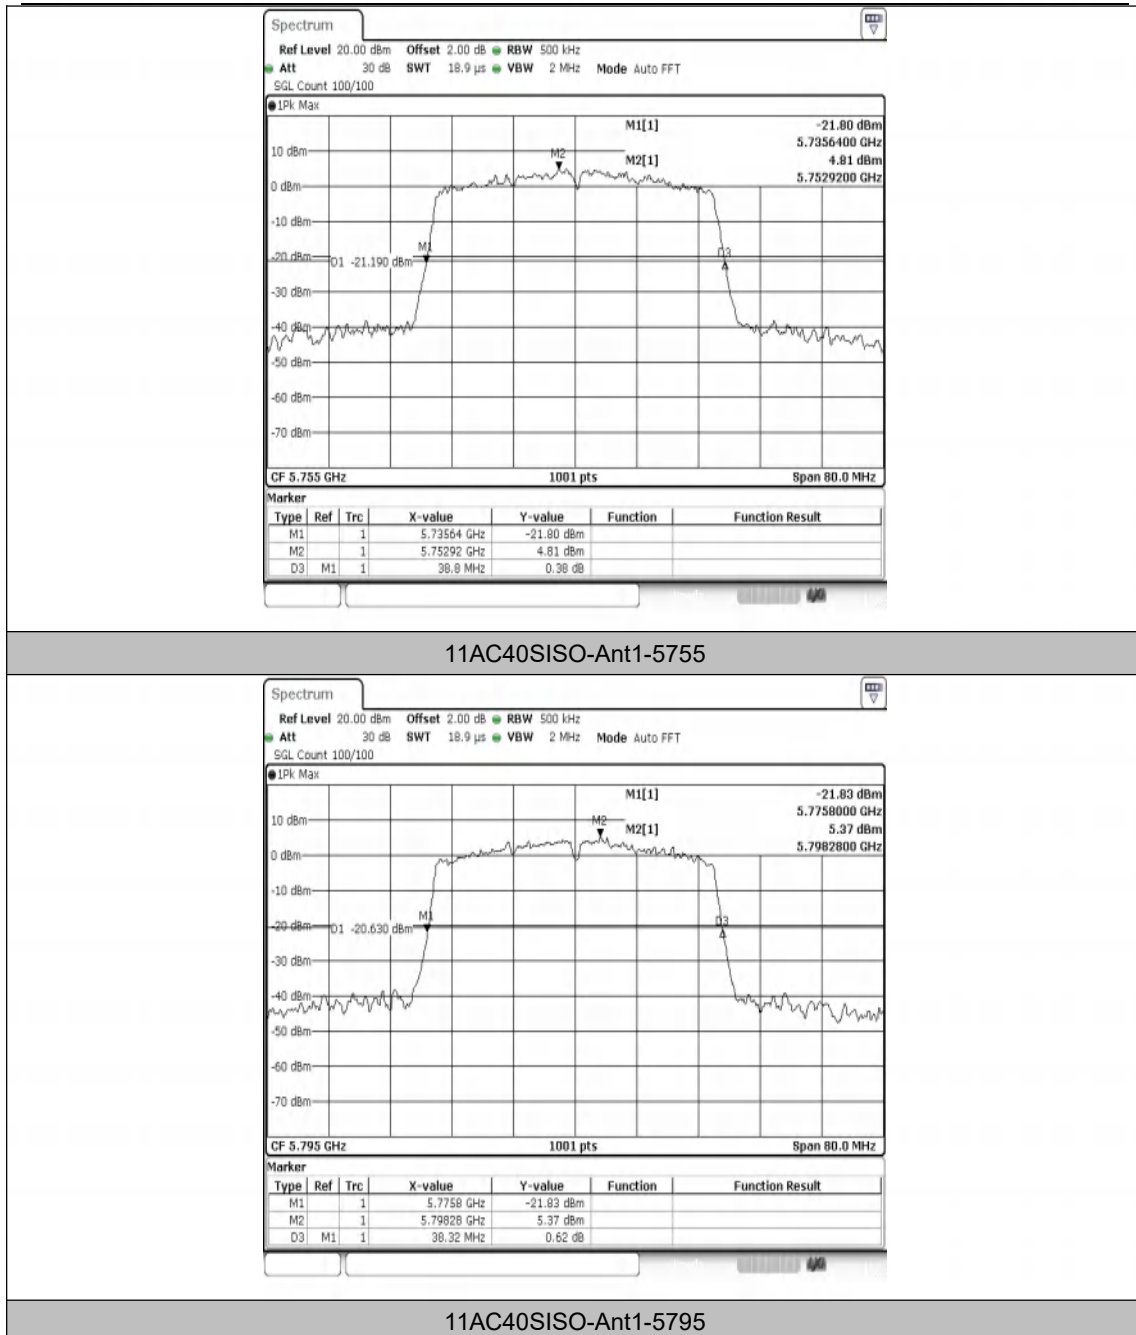


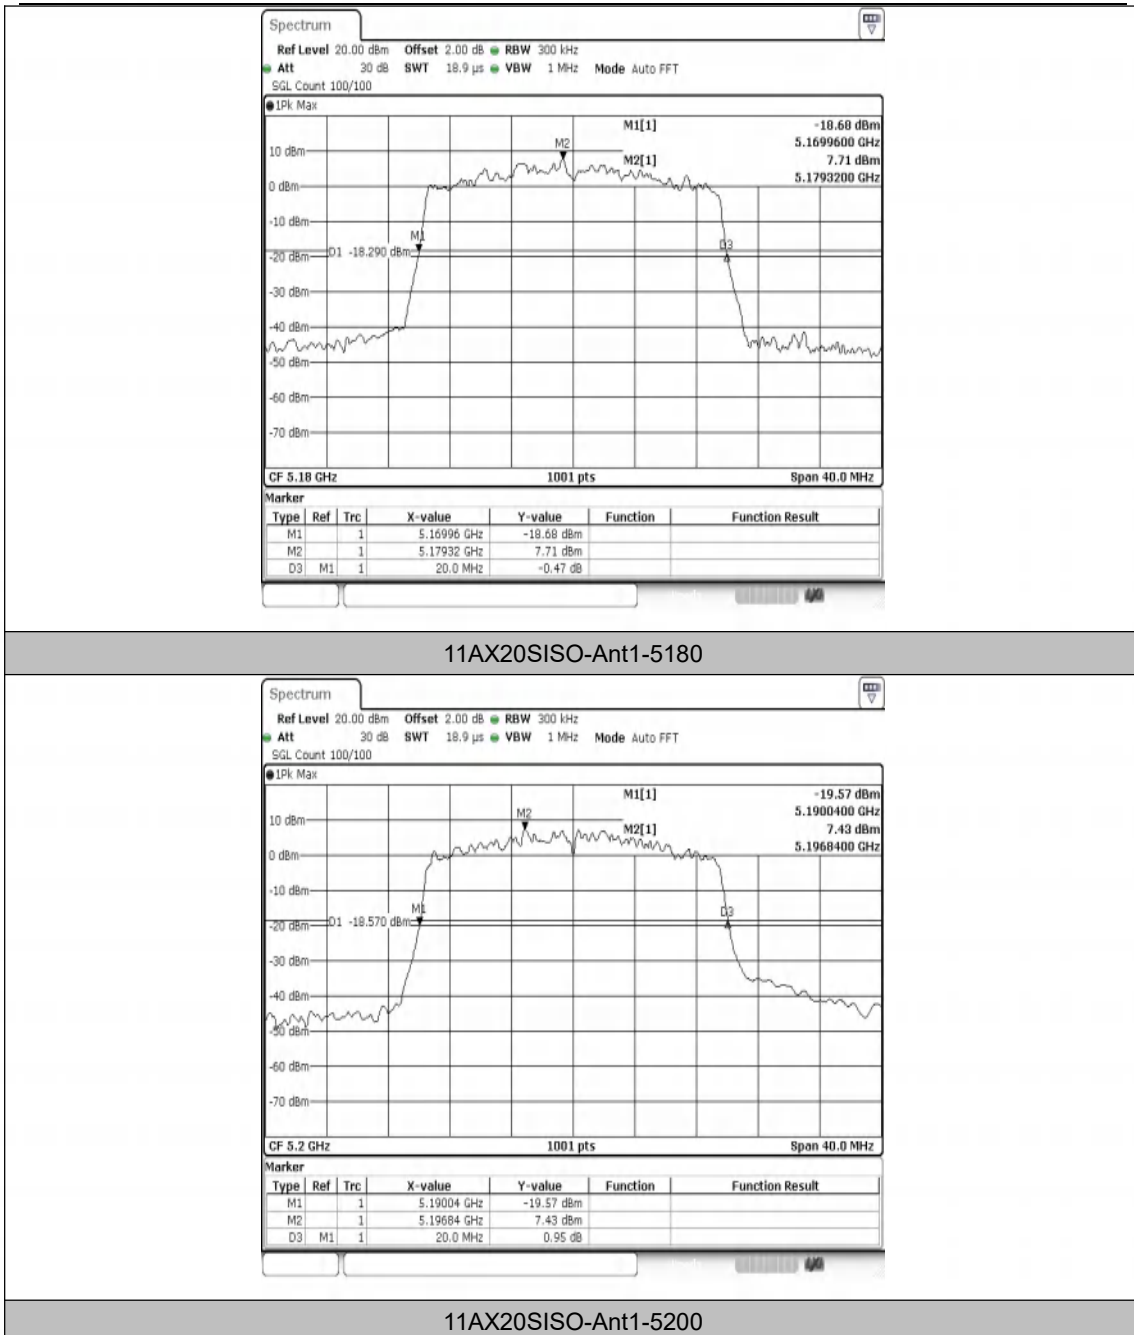

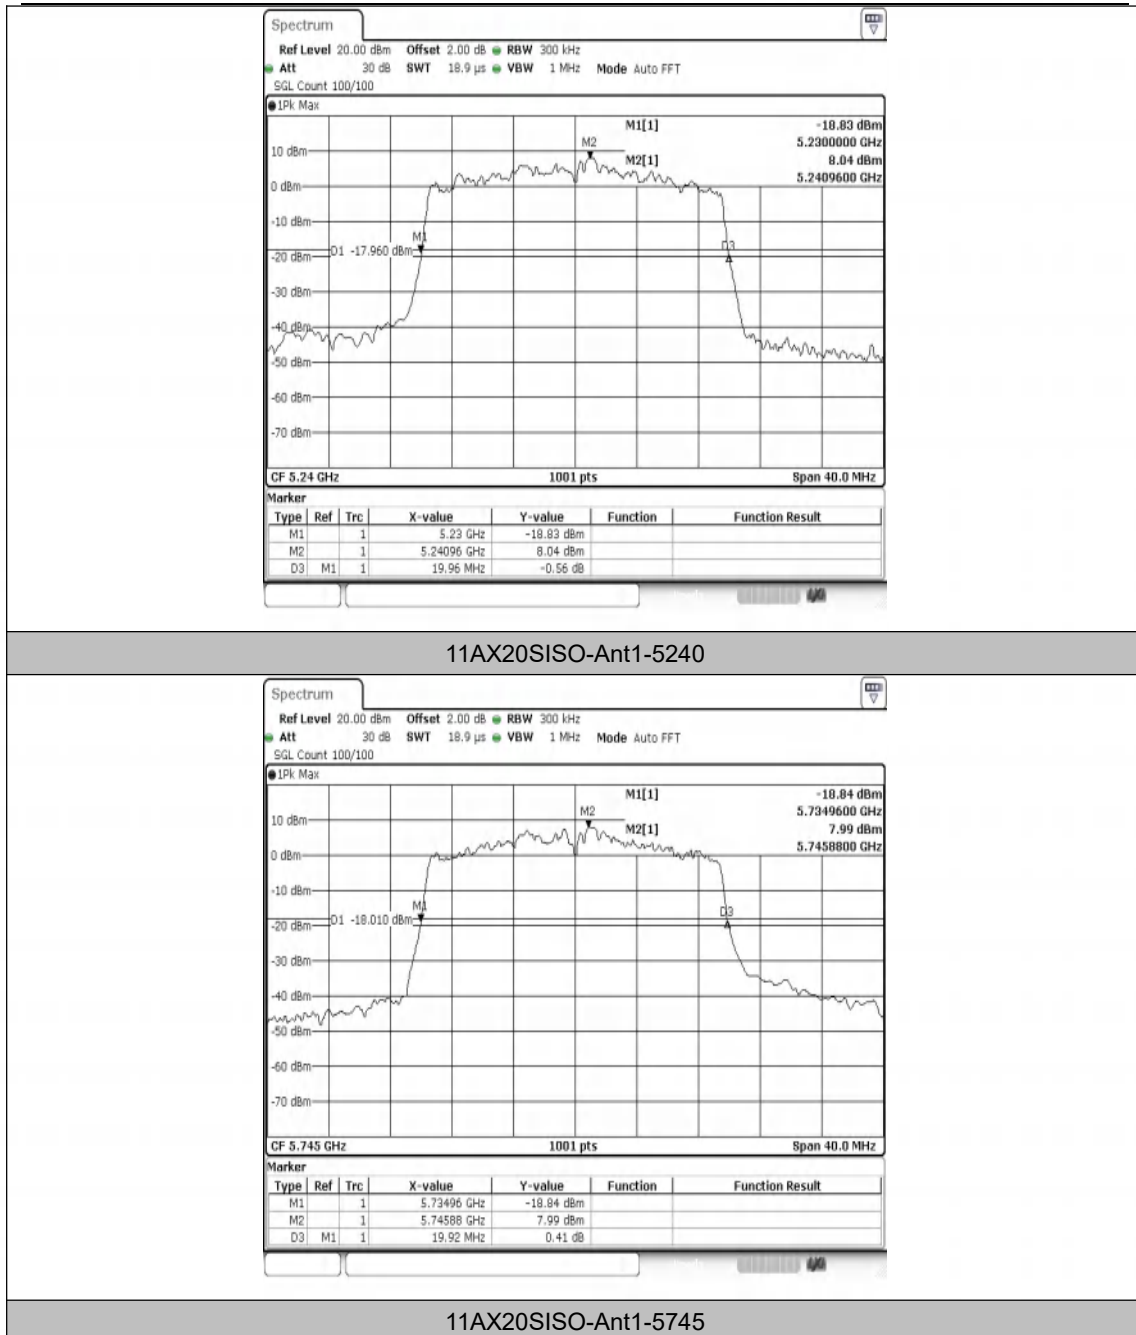

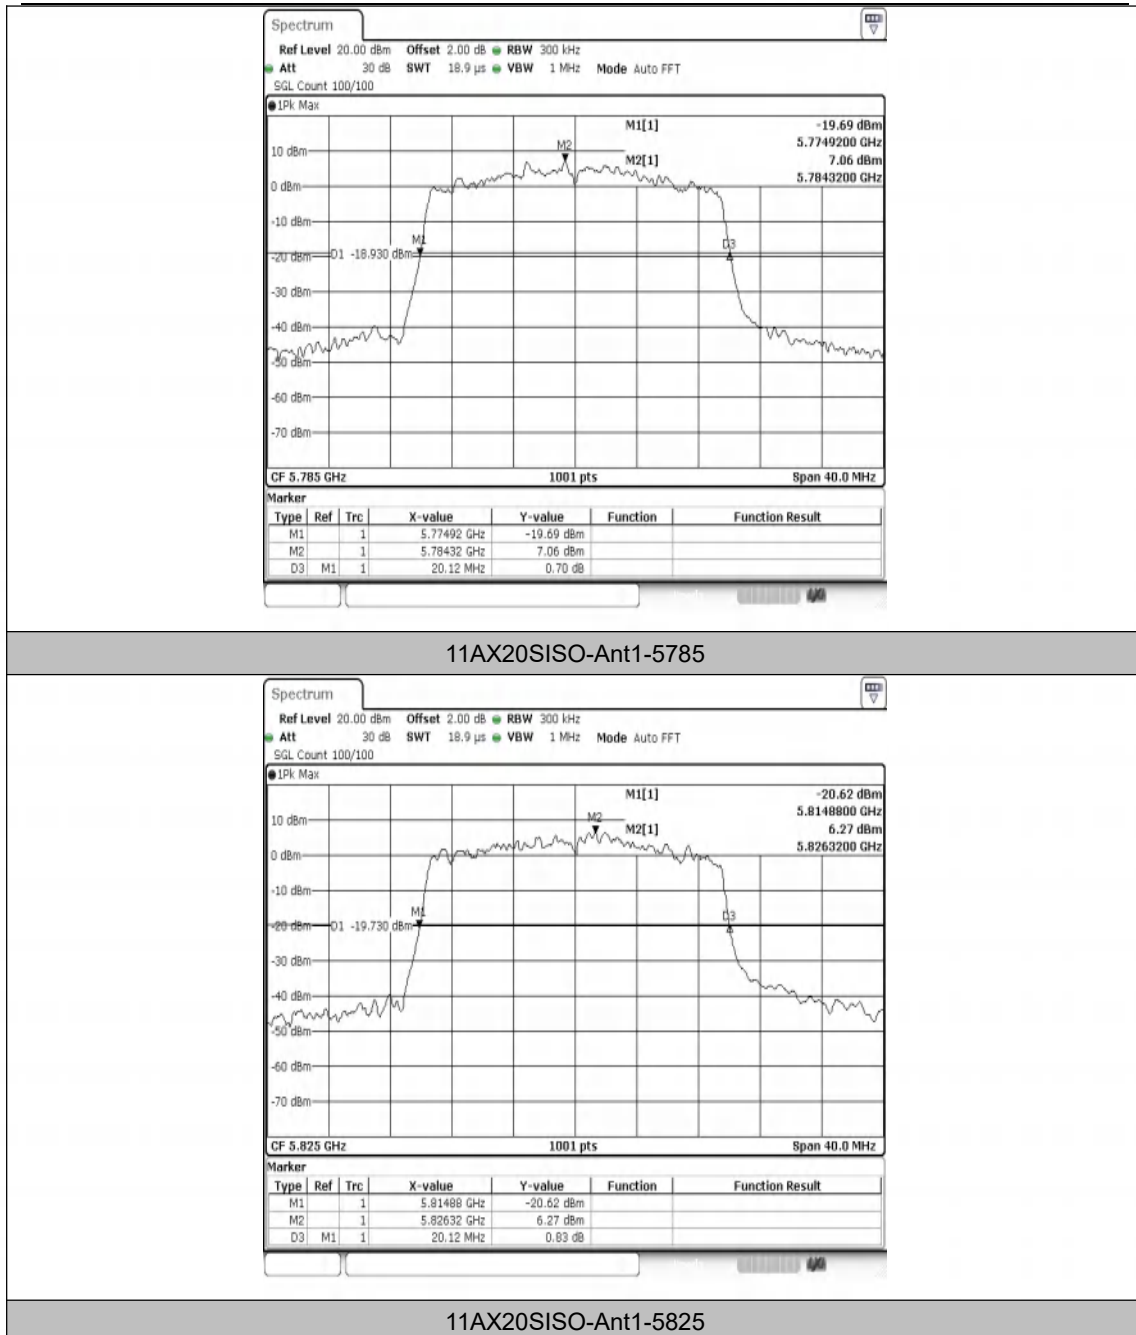

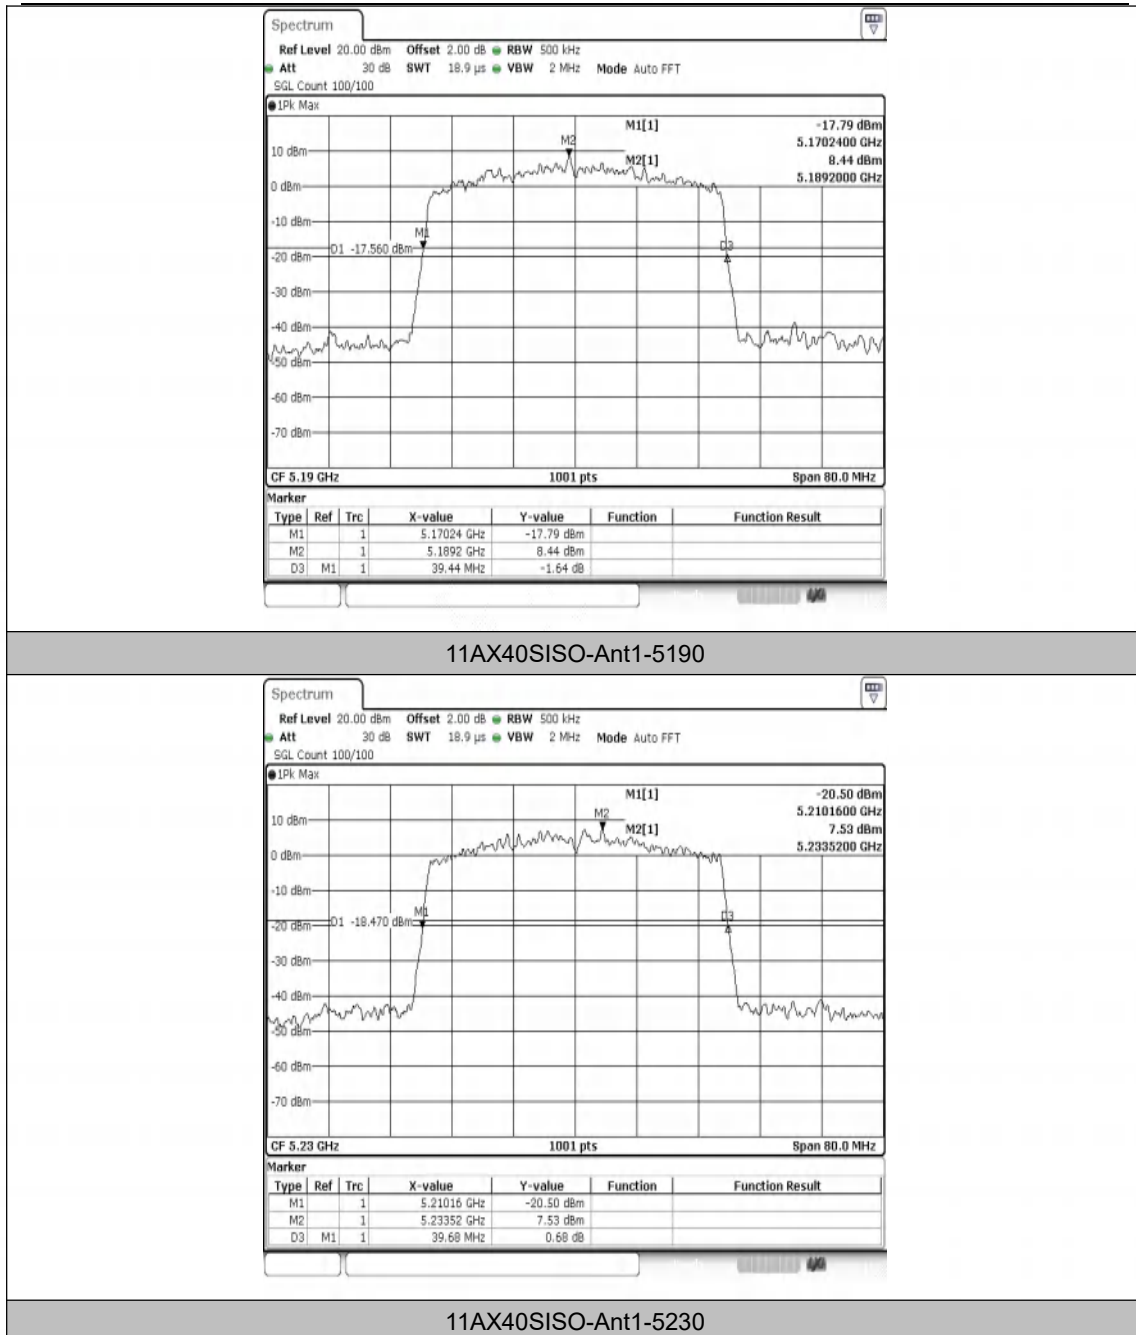

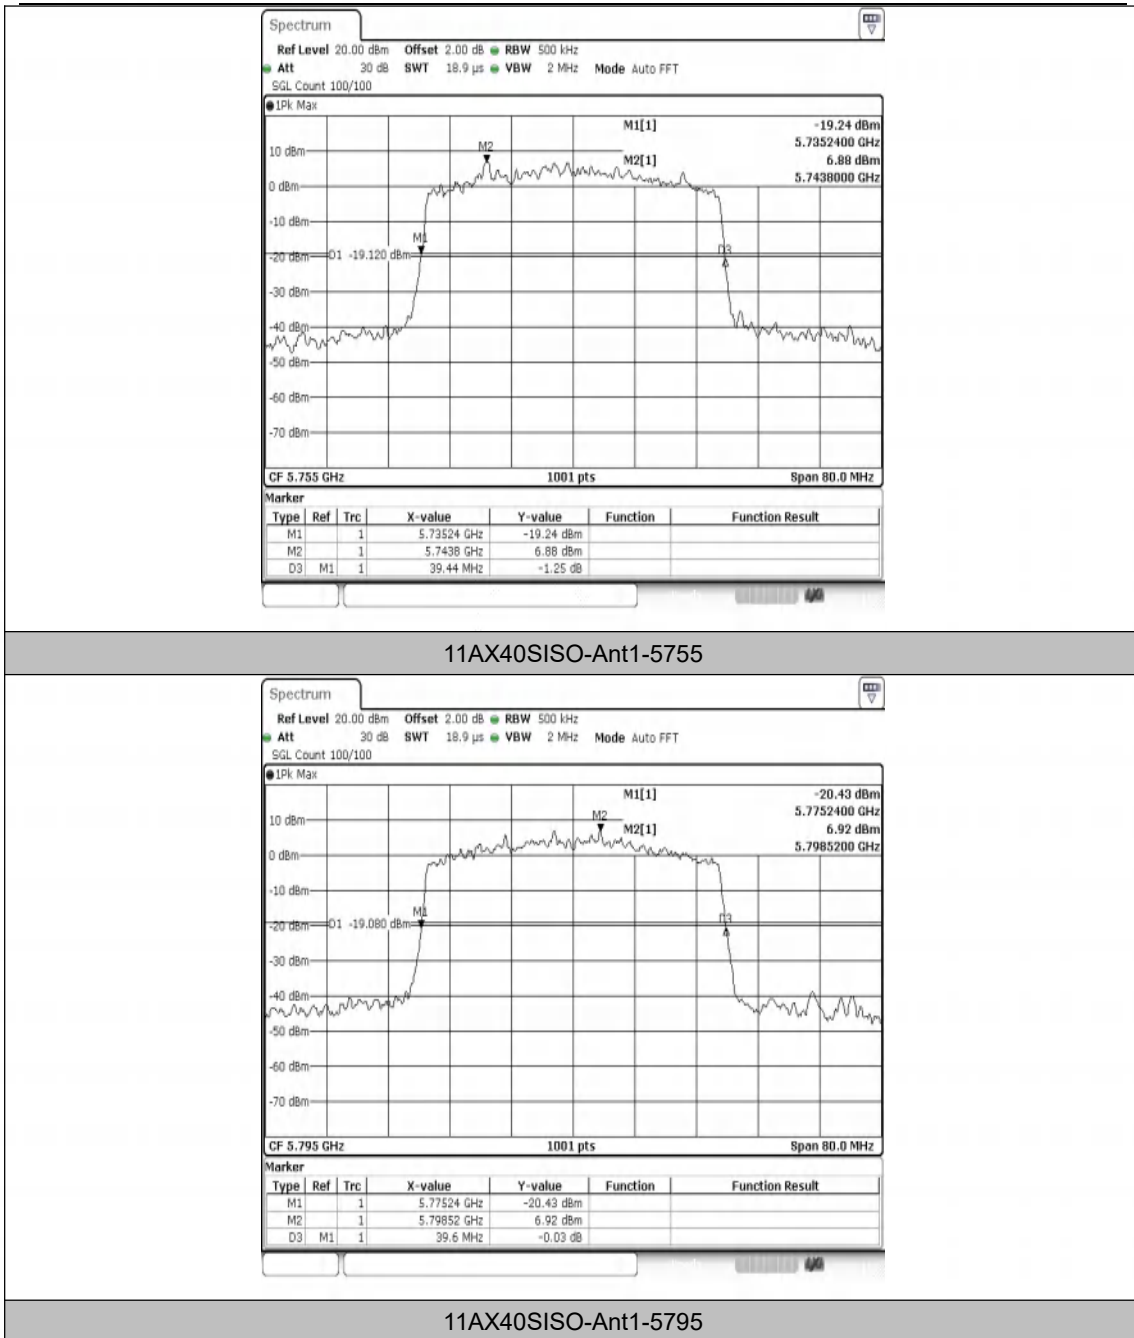


Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	16.184	5171.9281	5188.1119	---	---
11A	Ant1	5200	16.224	5191.8881	5208.1119	---	---
11A	Ant1	5240	16.224	5231.8881	5248.1119	---	---
11A	Ant1	5745	16.264	5736.8881	5753.1518	---	---
11A	Ant1	5785	16.264	5776.8482	5793.1119	---	---
11A	Ant1	5825	16.224	5816.8881	5833.1119	---	---
11N20SISO	Ant1	5180	17.343	5171.3287	5188.6713	---	---
11N20SISO	Ant1	5200	17.343	5191.3287	5208.6713	---	---
11N20SISO	Ant1	5240	17.263	5231.3686	5248.6314	---	---
11N20SISO	Ant1	5745	17.303	5736.3287	5753.6314	---	---
11N20SISO	Ant1	5785	17.303	5776.3287	5793.6314	---	---
11N20SISO	Ant1	5825	17.303	5816.3287	5833.6314	---	---
11N40SISO	Ant1	5190	35.724	5172.0979	5207.8222	---	---
11N40SISO	Ant1	5230	35.724	5212.0979	5247.8222	---	---
11N40SISO	Ant1	5755	35.724	5737.0180	5772.7423	---	---
11N40SISO	Ant1	5795	35.644	5777.0979	5812.7423	---	---
11AC20SISO	Ant1	5180	17.383	5171.2887	5188.6713	---	---
11AC20SISO	Ant1	5200	17.383	5191.2887	5208.6713	---	---
11AC20SISO	Ant1	5240	17.423	5231.2887	5248.7113	---	---
11AC20SISO	Ant1	5745	17.383	5736.2887	5753.6713	---	---
11AC20SISO	Ant1	5785	17.383	5776.2887	5793.6713	---	---
11AC20SISO	Ant1	5825	17.423	5816.2488	5833.6713	---	---
11AC40SISO	Ant1	5190	35.485	5172.2577	5207.7423	---	---
11AC40SISO	Ant1	5230	35.485	5212.2577	5247.7423	---	---
11AC40SISO	Ant1	5755	35.564	5737.1778	5772.7423	---	---
11AC40SISO	Ant1	5795	35.485	5777.1778	5812.6623	---	---
11AX20SISO	Ant1	5180	18.581	5170.6494	5189.2308	---	---
11AX20SISO	Ant1	5200	18.621	5190.6094	5209.2308	---	---
11AX20SISO	Ant1	5240	18.661	5230.5694	5249.2308	---	---
11AX20SISO	Ant1	5745	18.581	5735.6494	5754.2308	---	---
11AX20SISO	Ant1	5785	18.621	5775.6094	5794.2308	---	---
11AX20SISO	Ant1	5825	18.661	5815.5694	5834.2308	---	---
11AX40SISO	Ant1	5190	37.083	5171.5385	5208.6214	---	---
11AX40SISO	Ant1	5230	36.923	5211.5385	5248.4615	---	---
11AX40SISO	Ant1	5755	37.003	5736.5385	5773.5415	---	---
11AX40SISO	Ant1	5795	36.923	5776.5385	5813.4615	---	---


Test Graphs

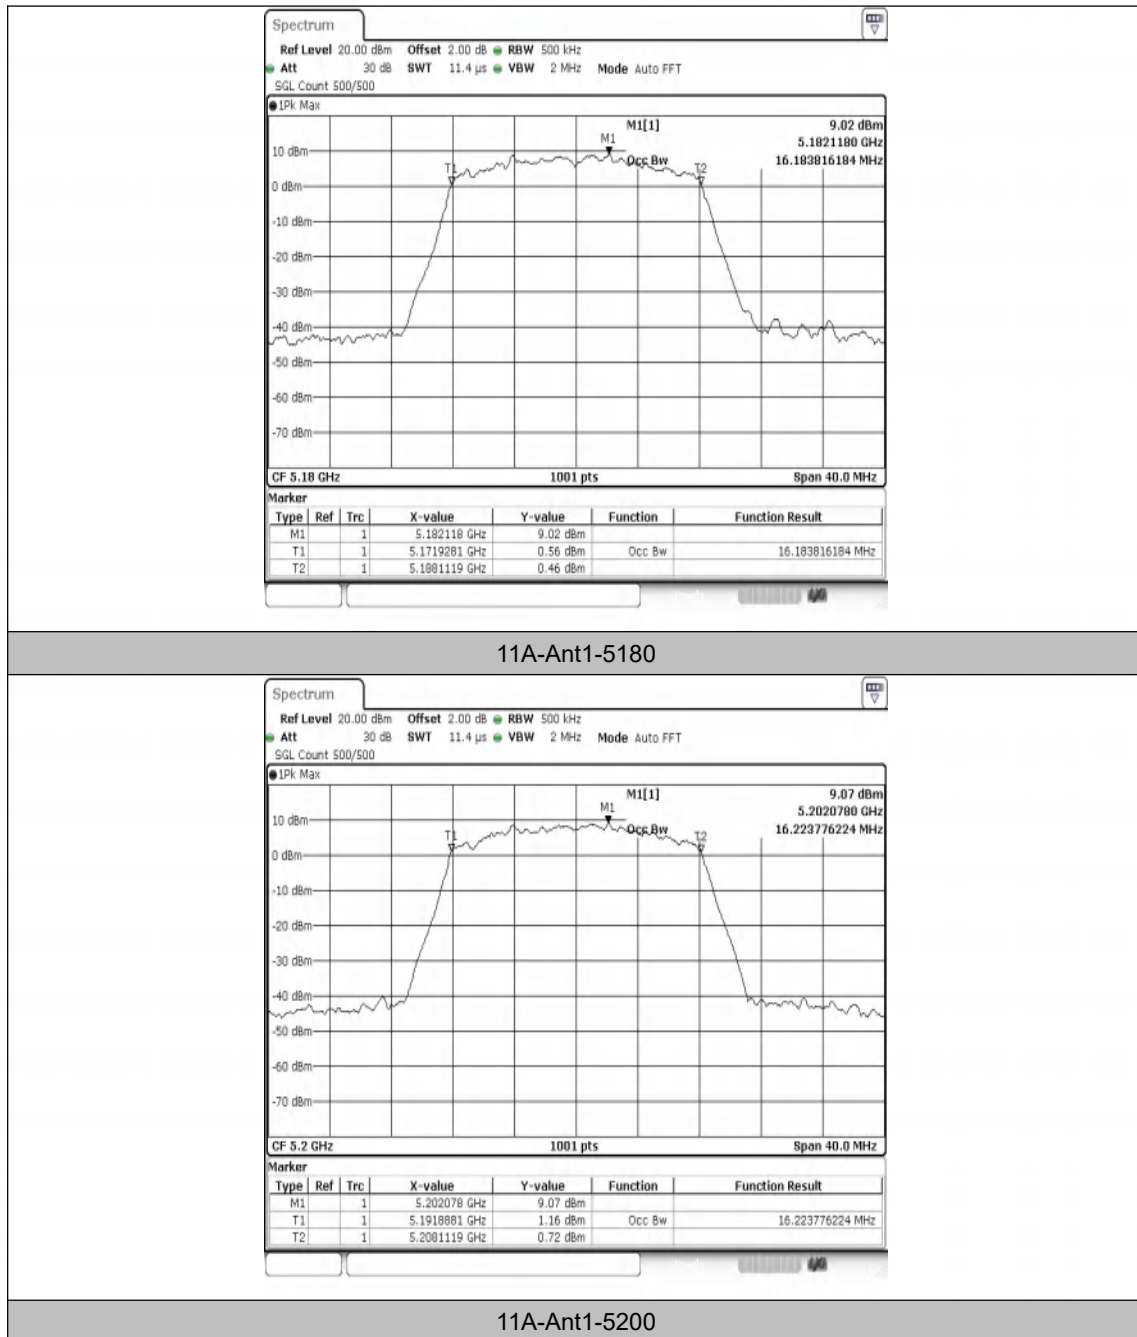



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

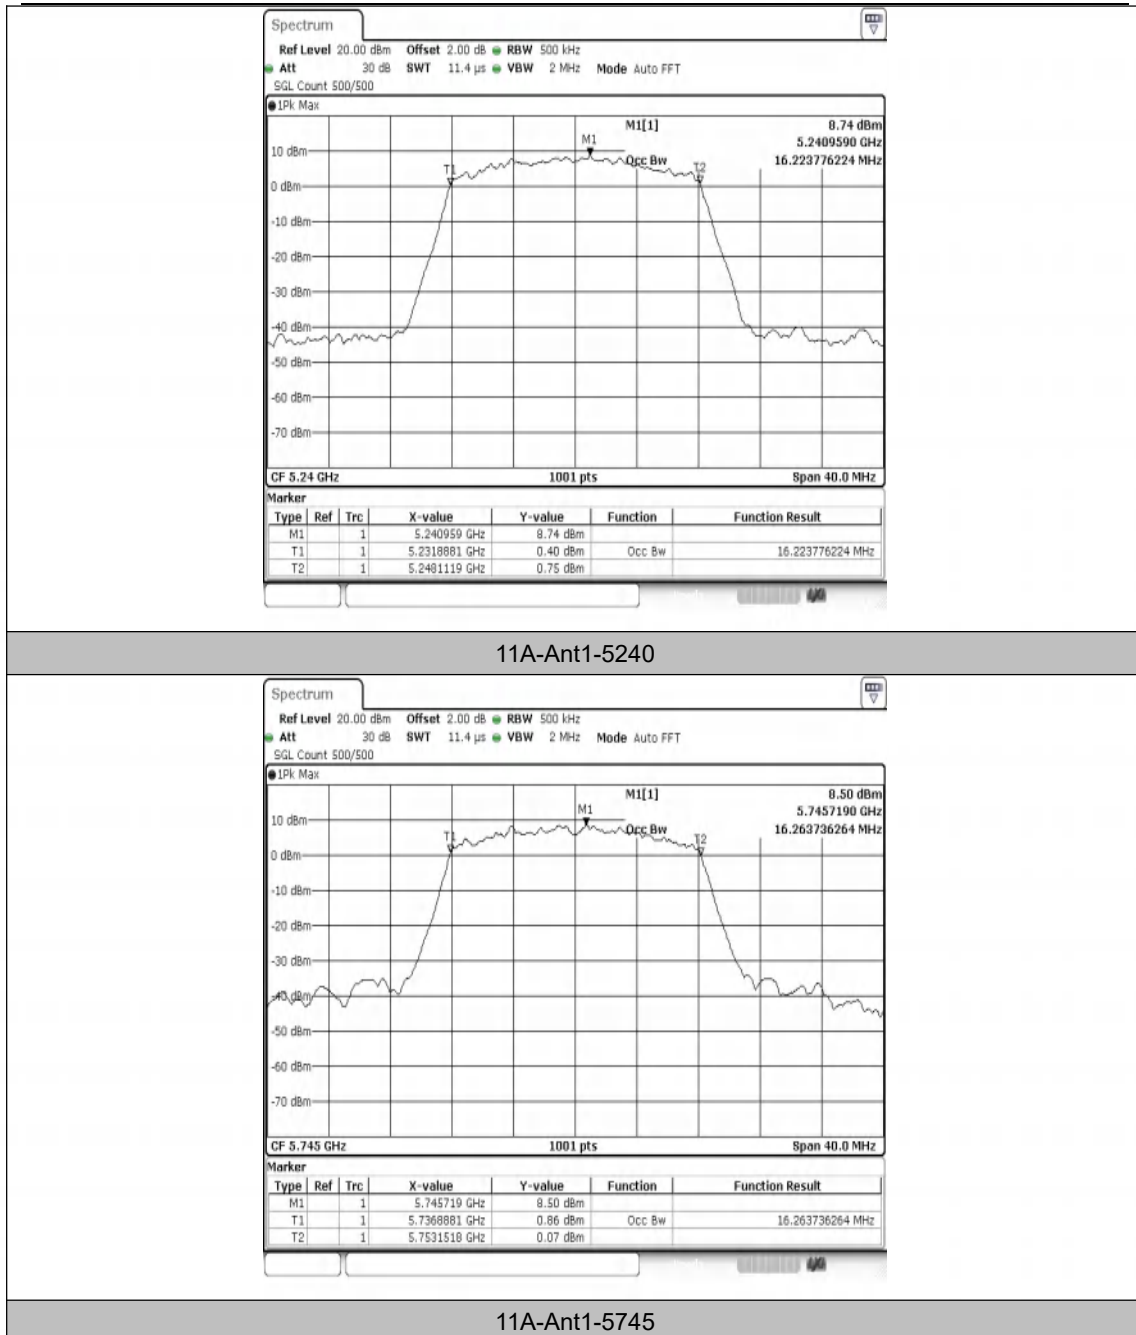


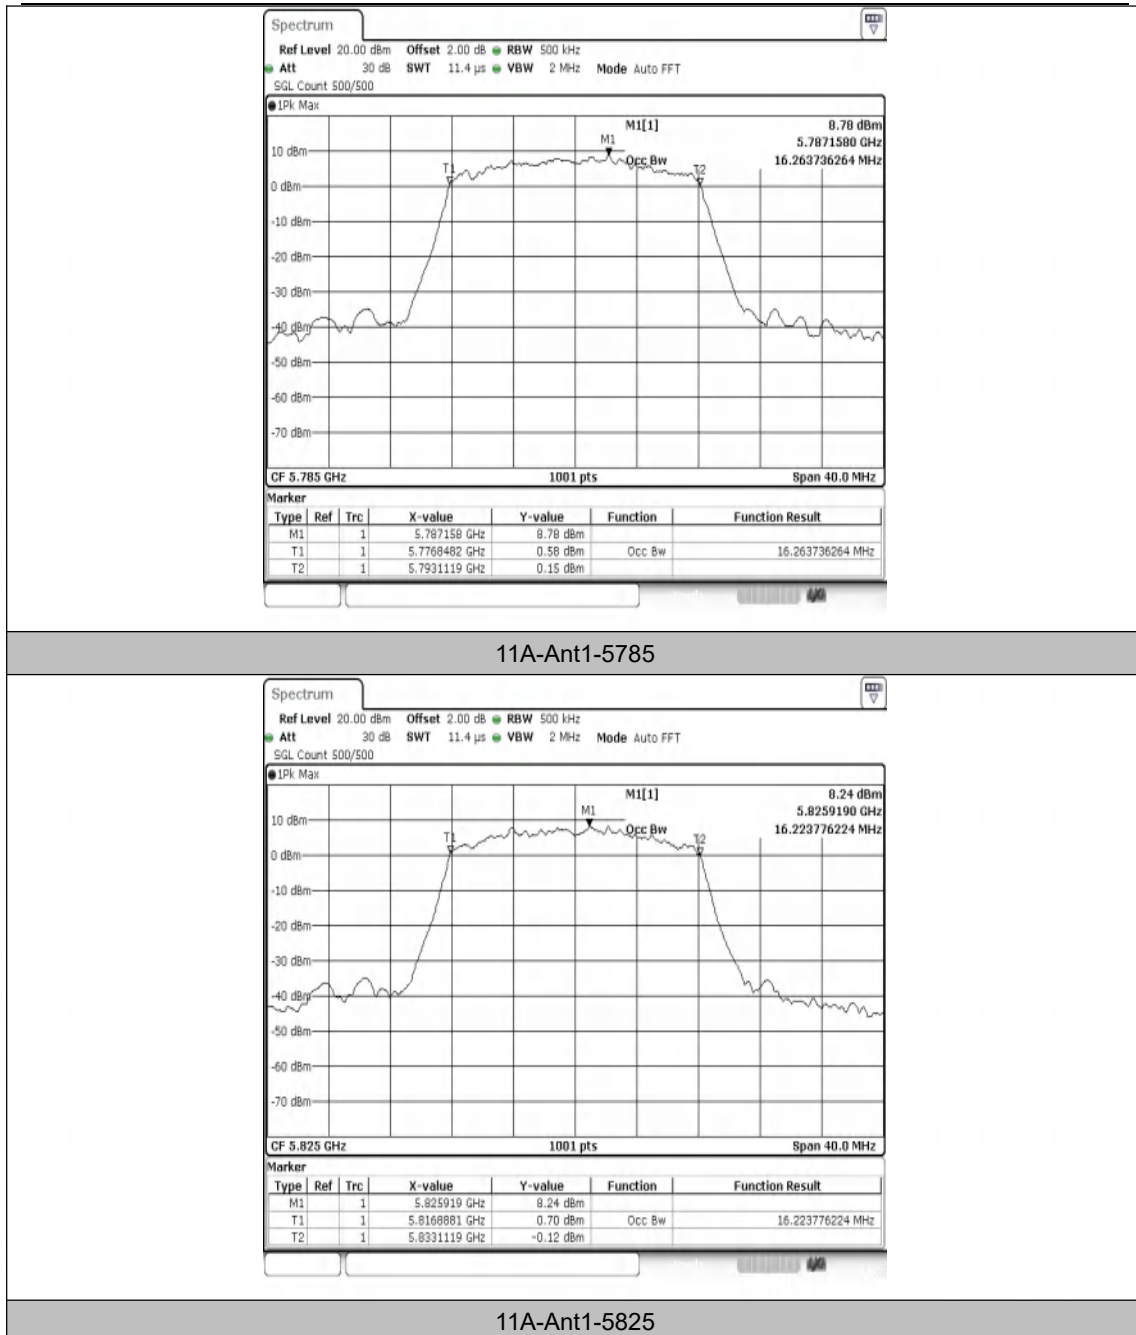


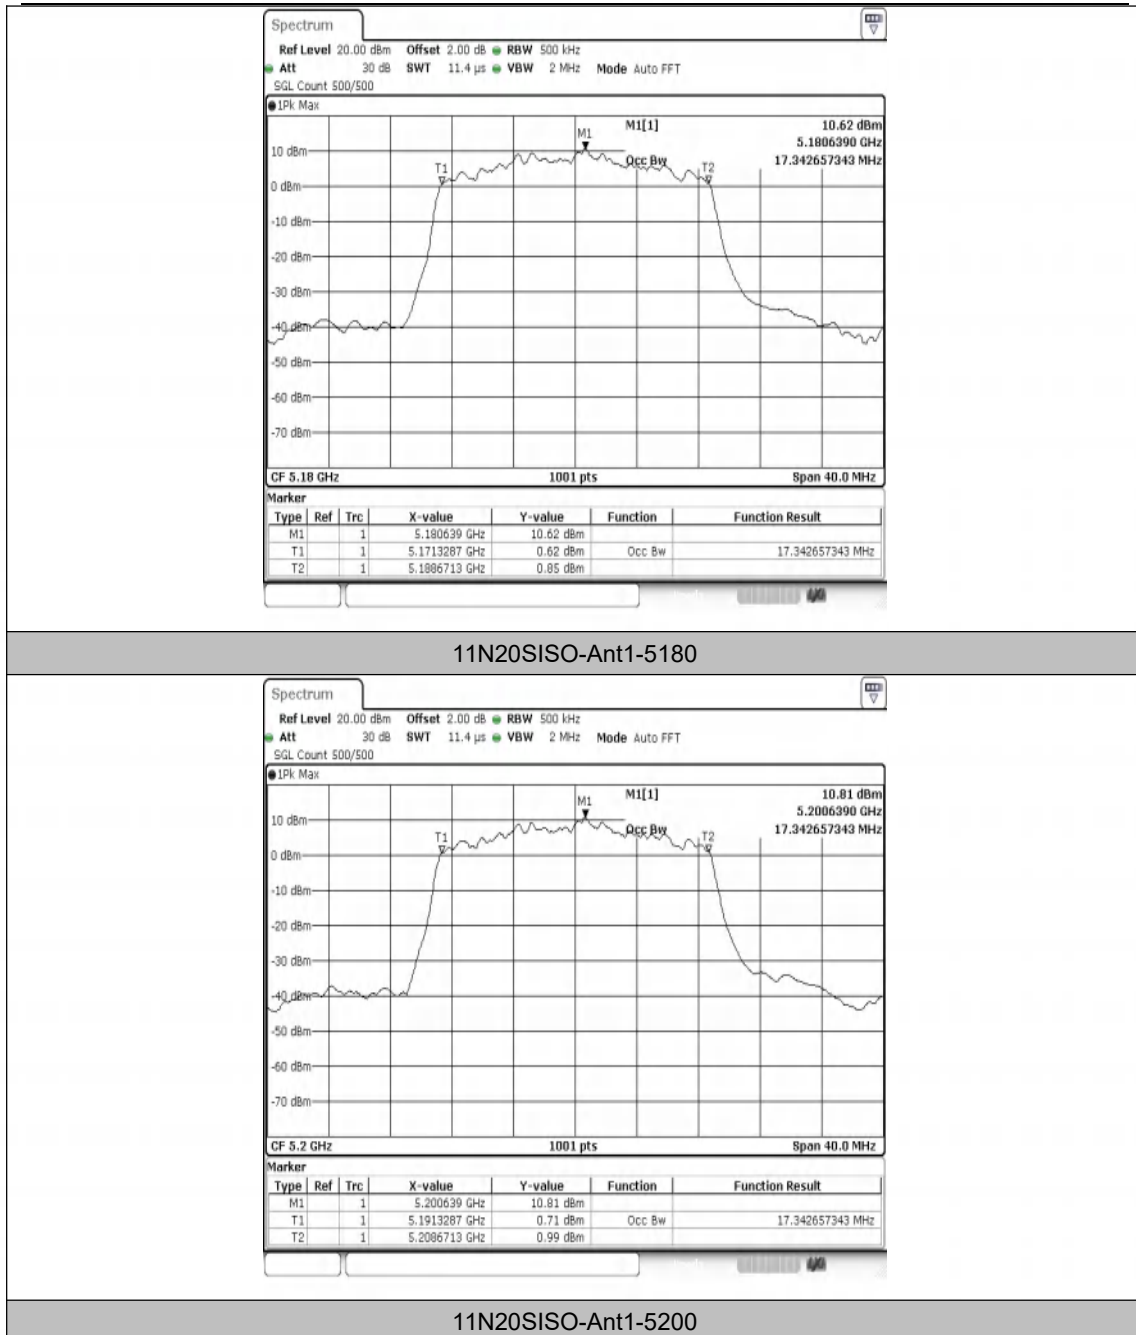


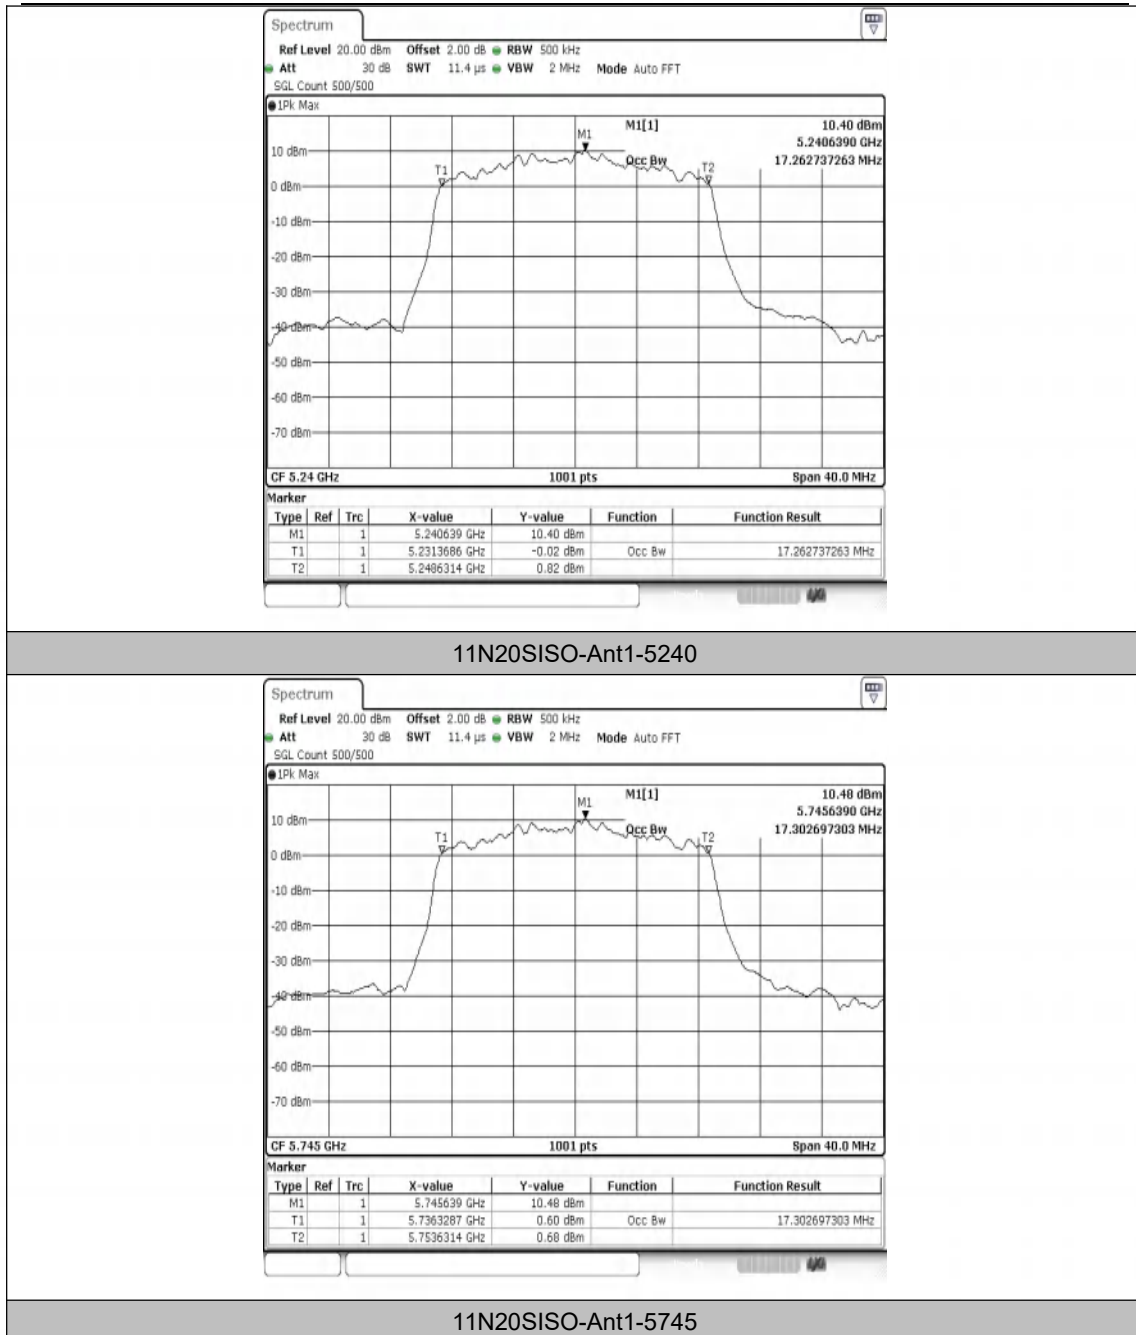


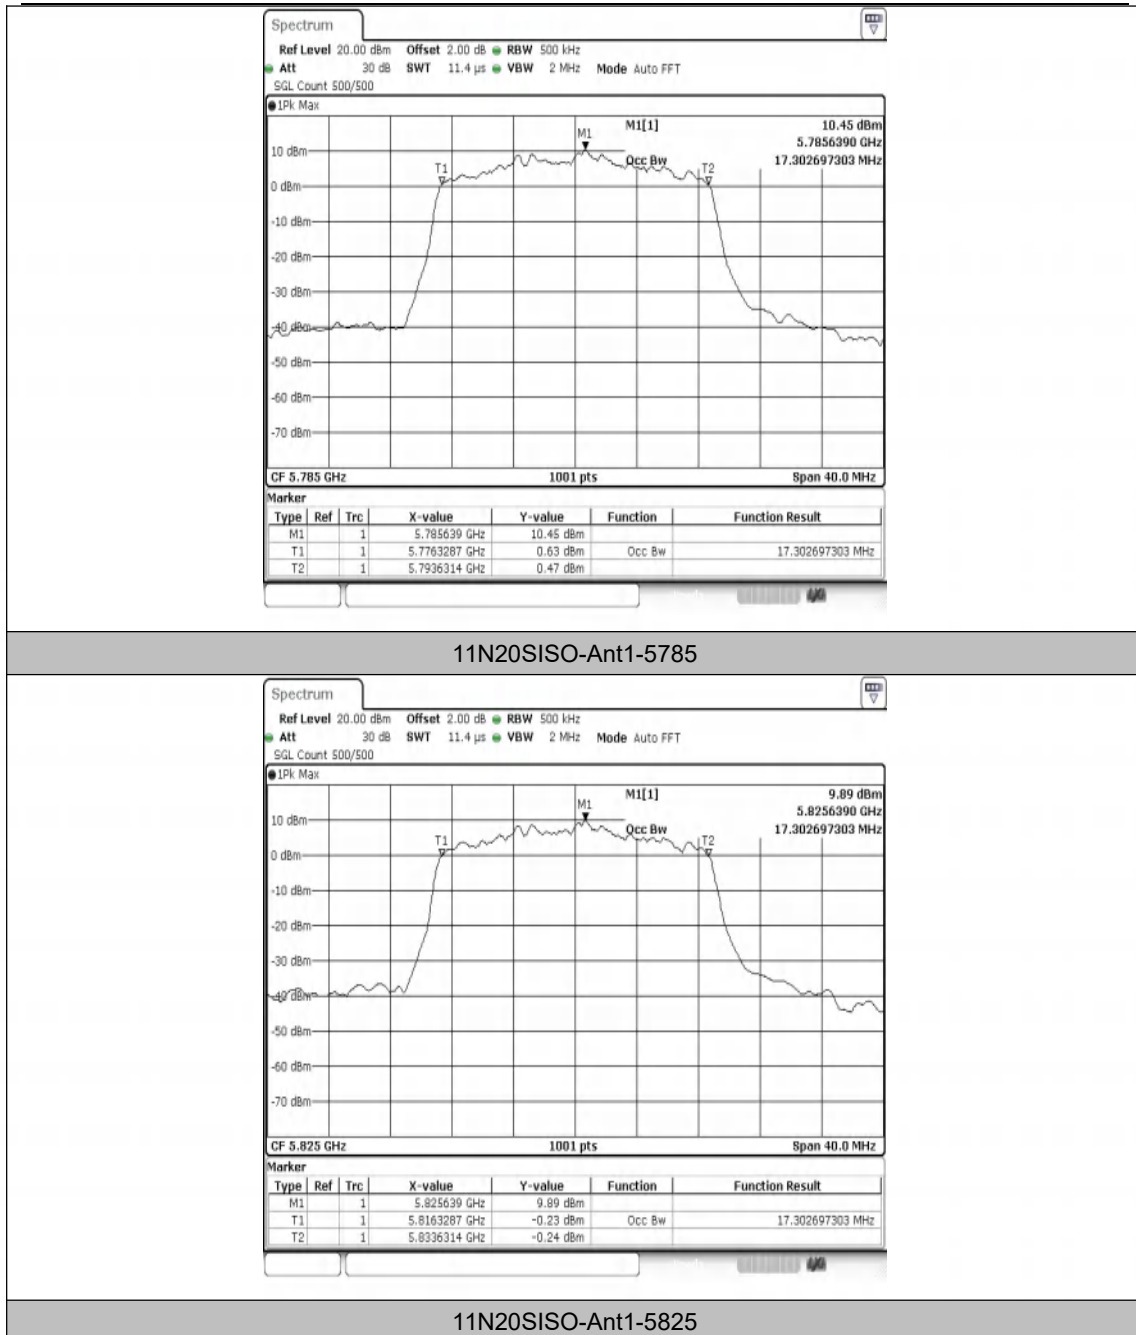


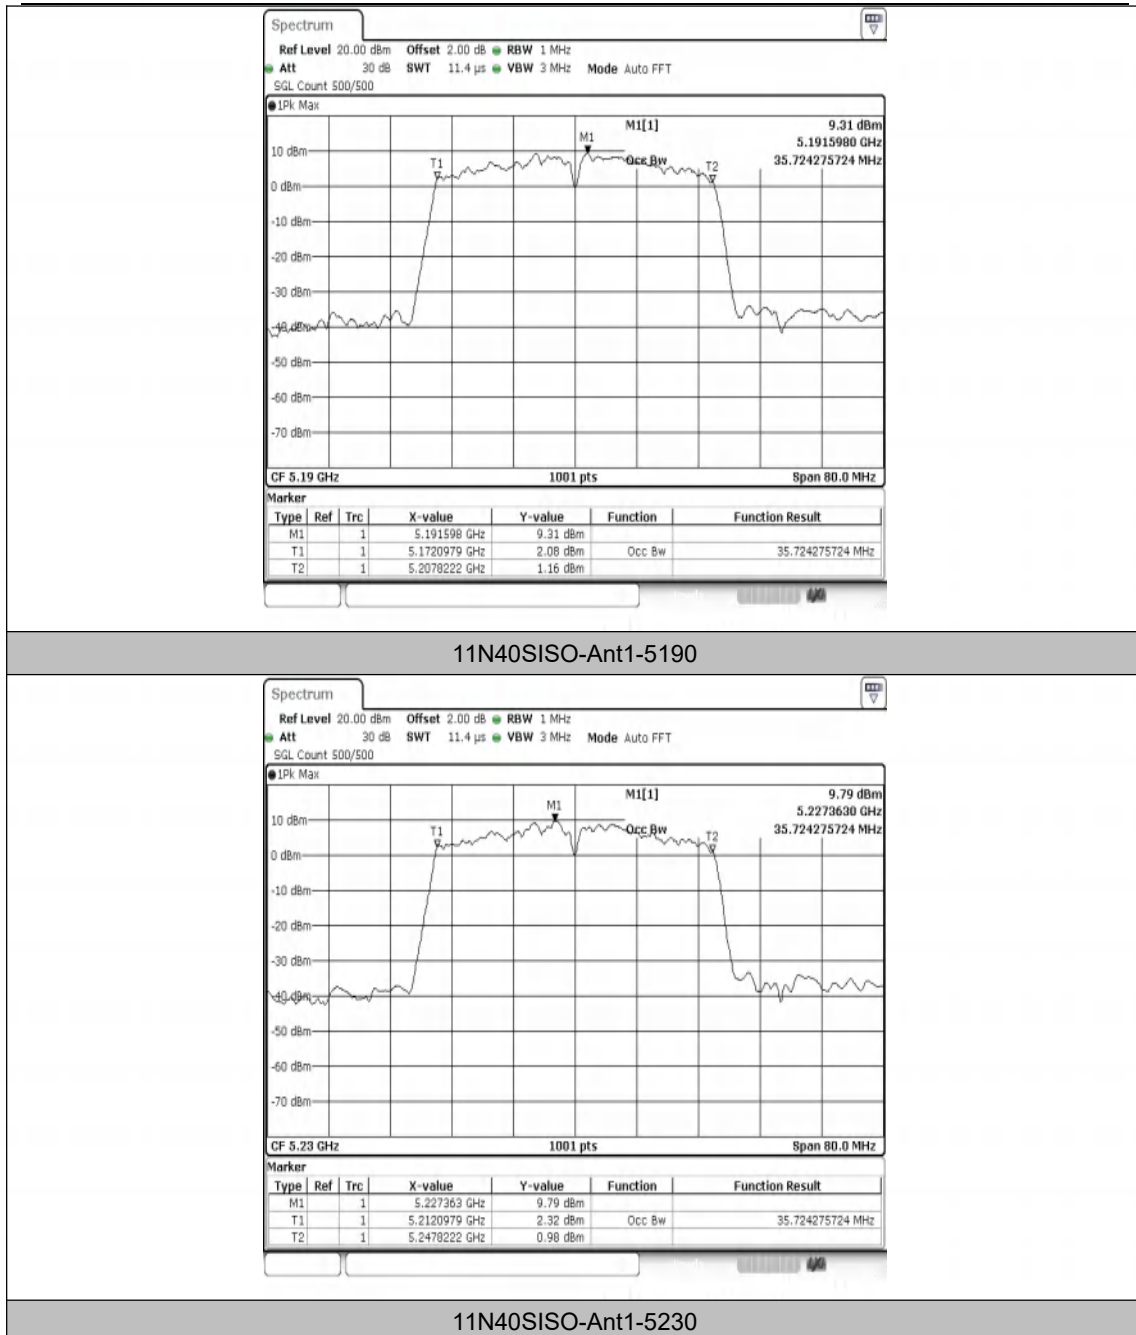


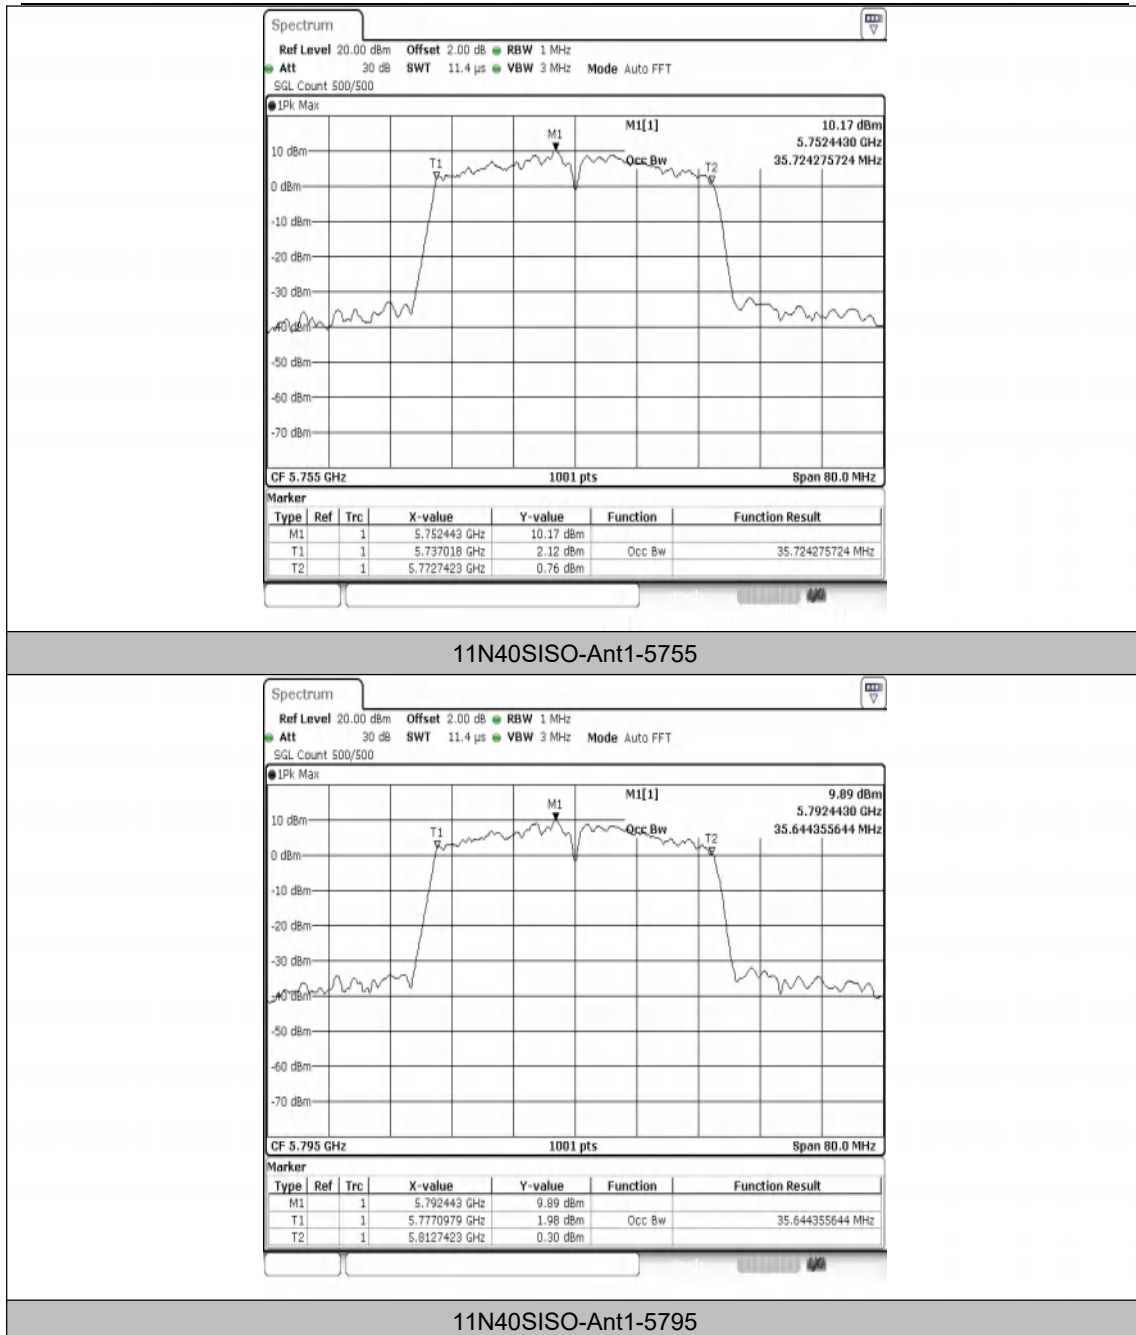


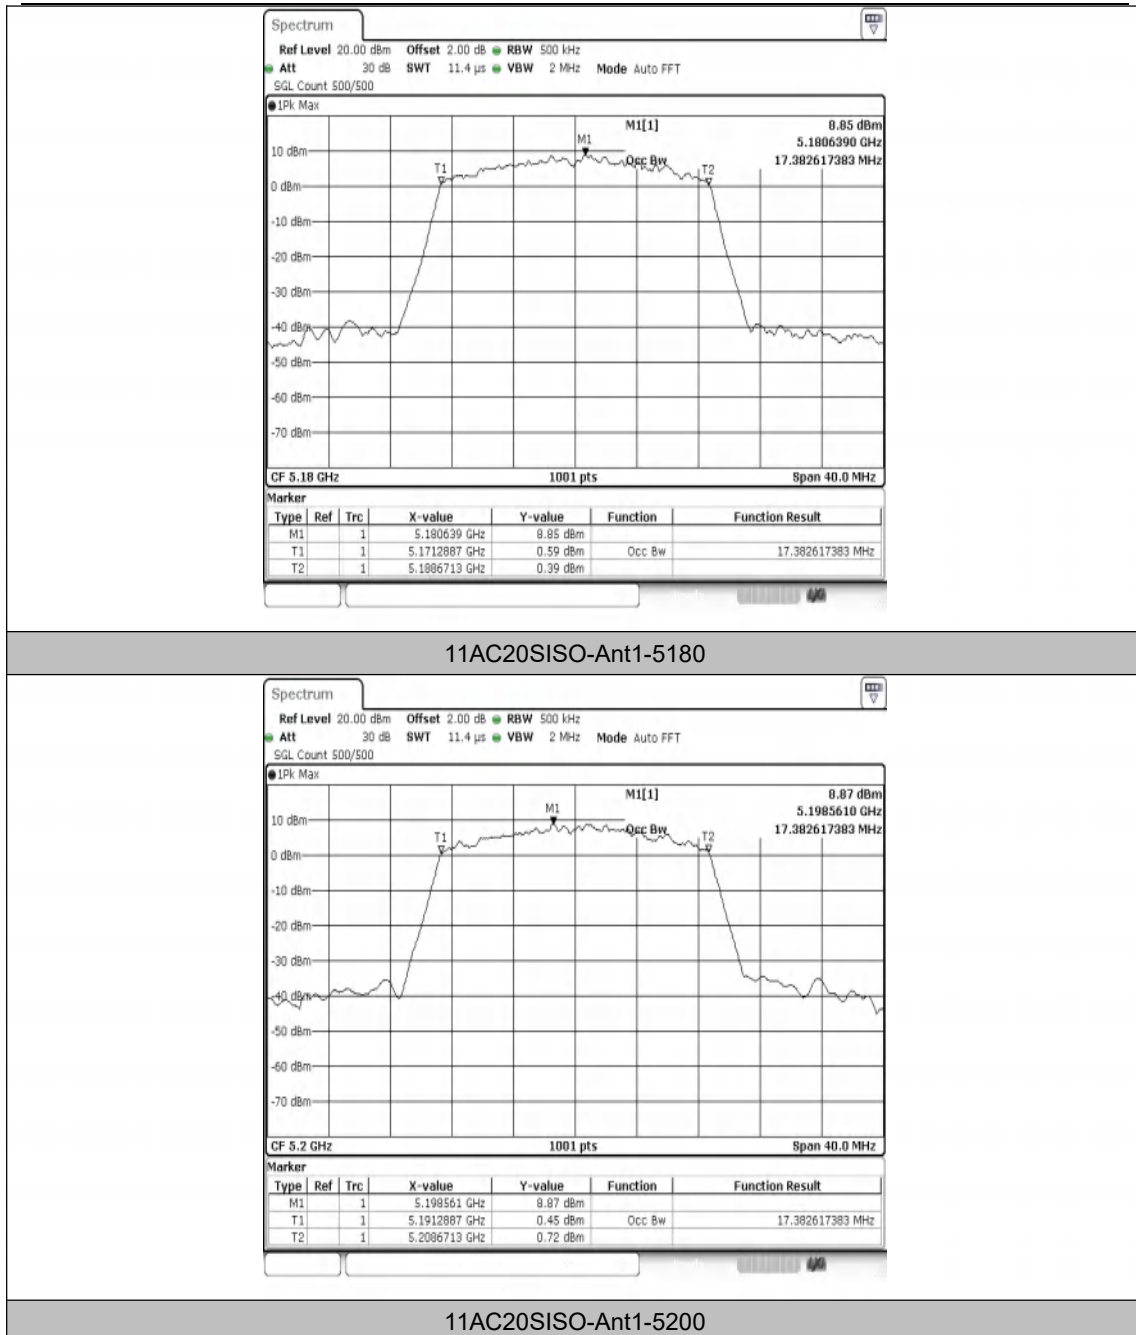

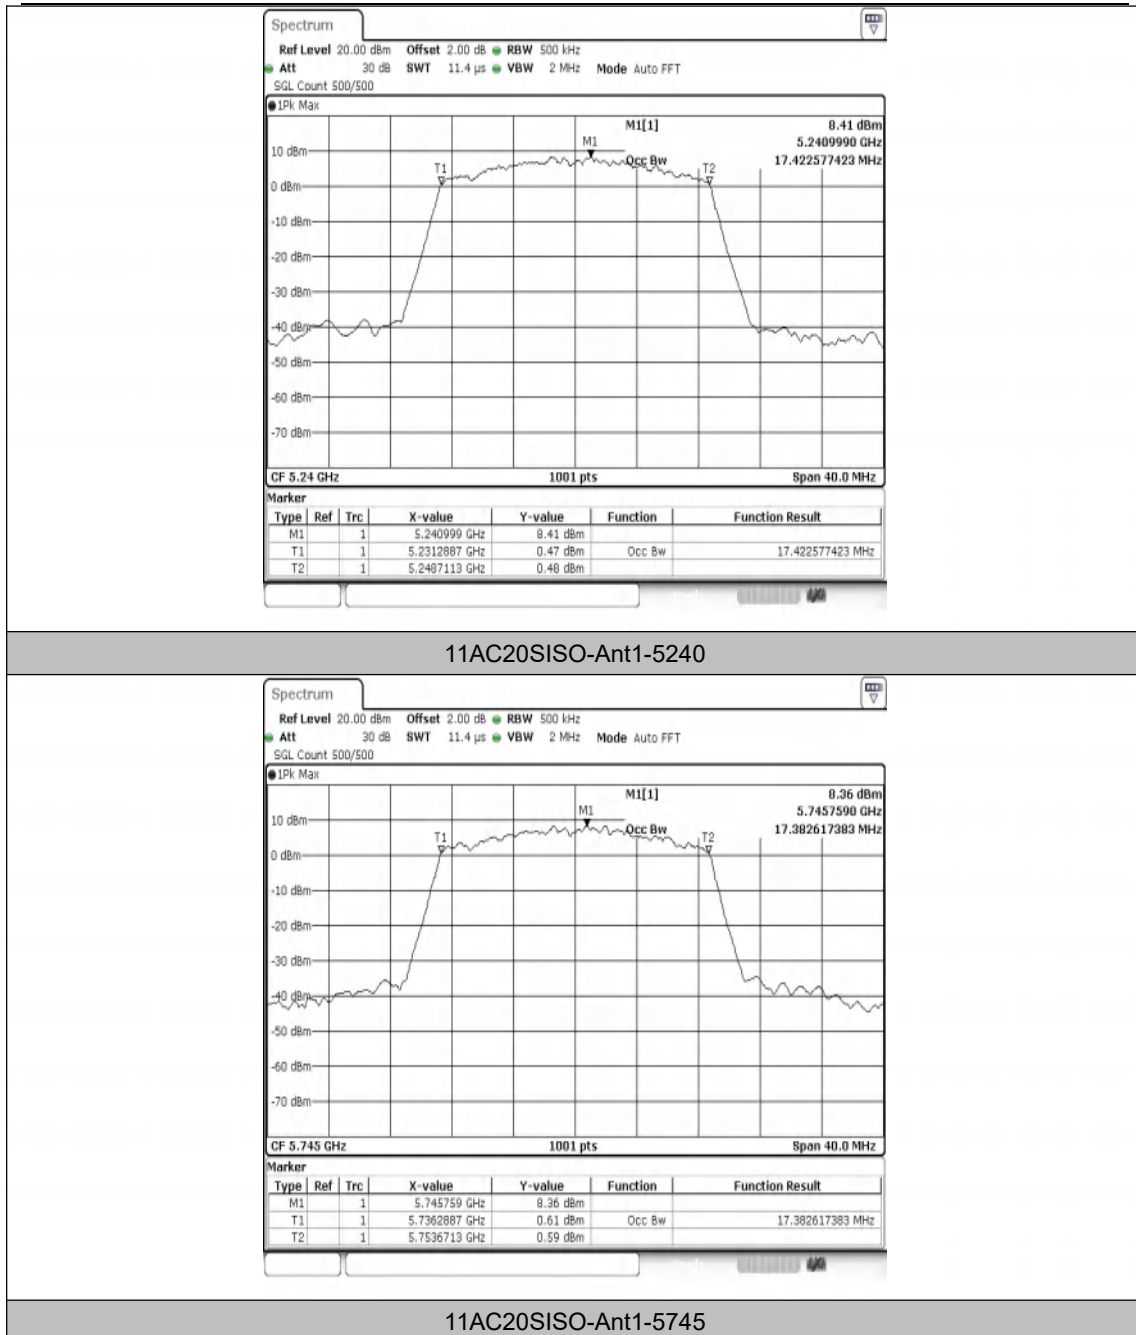


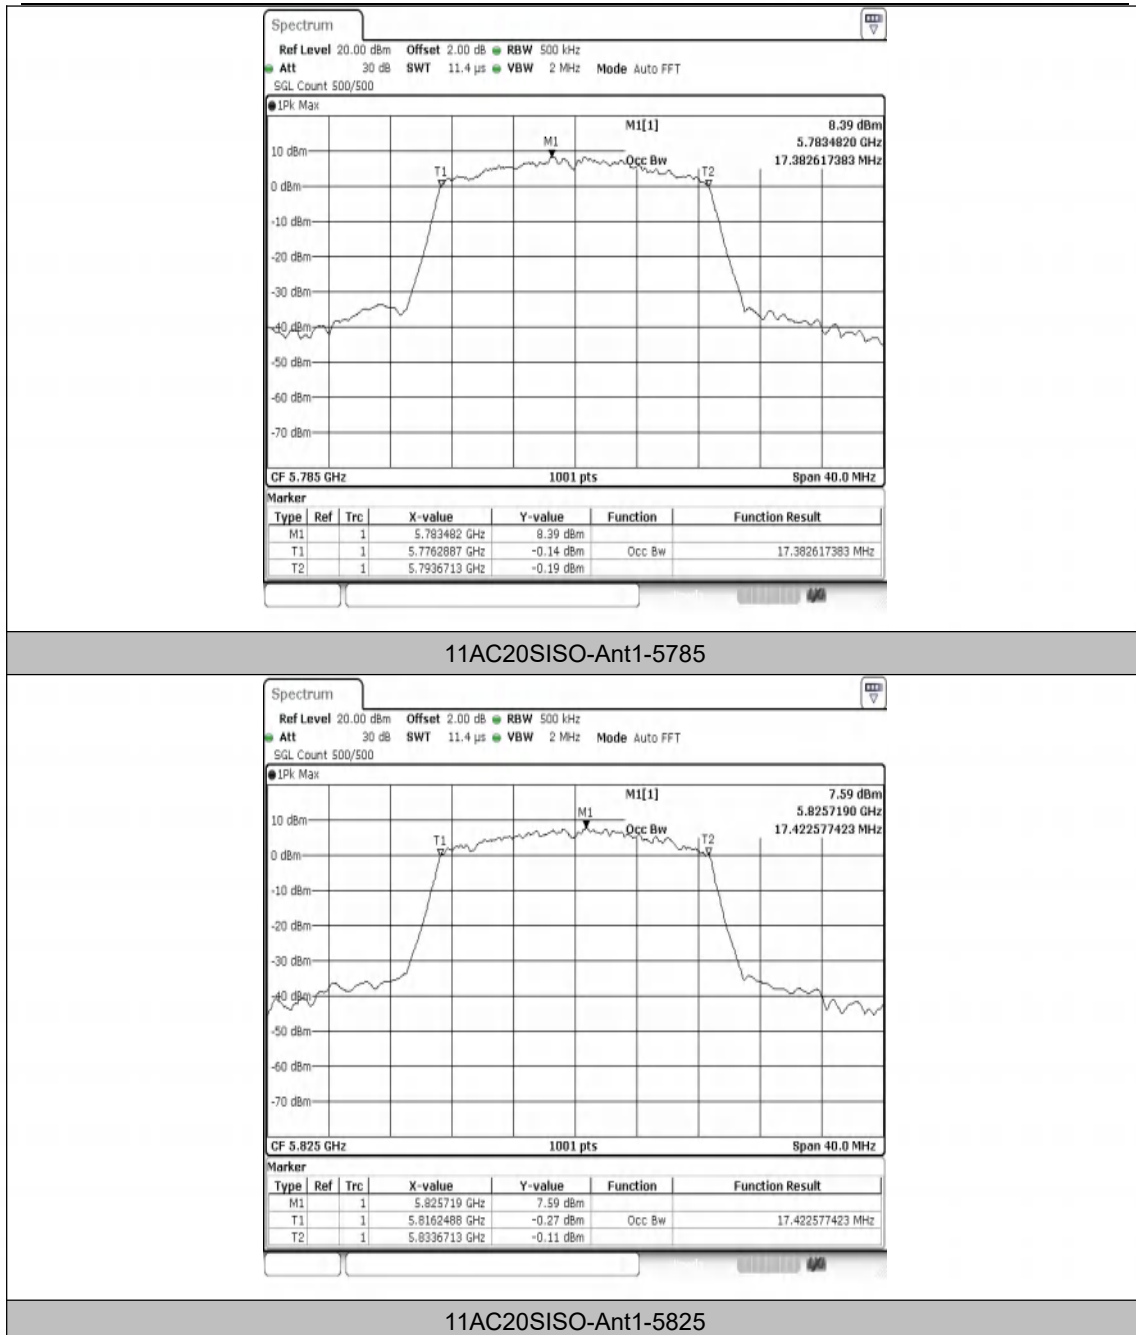


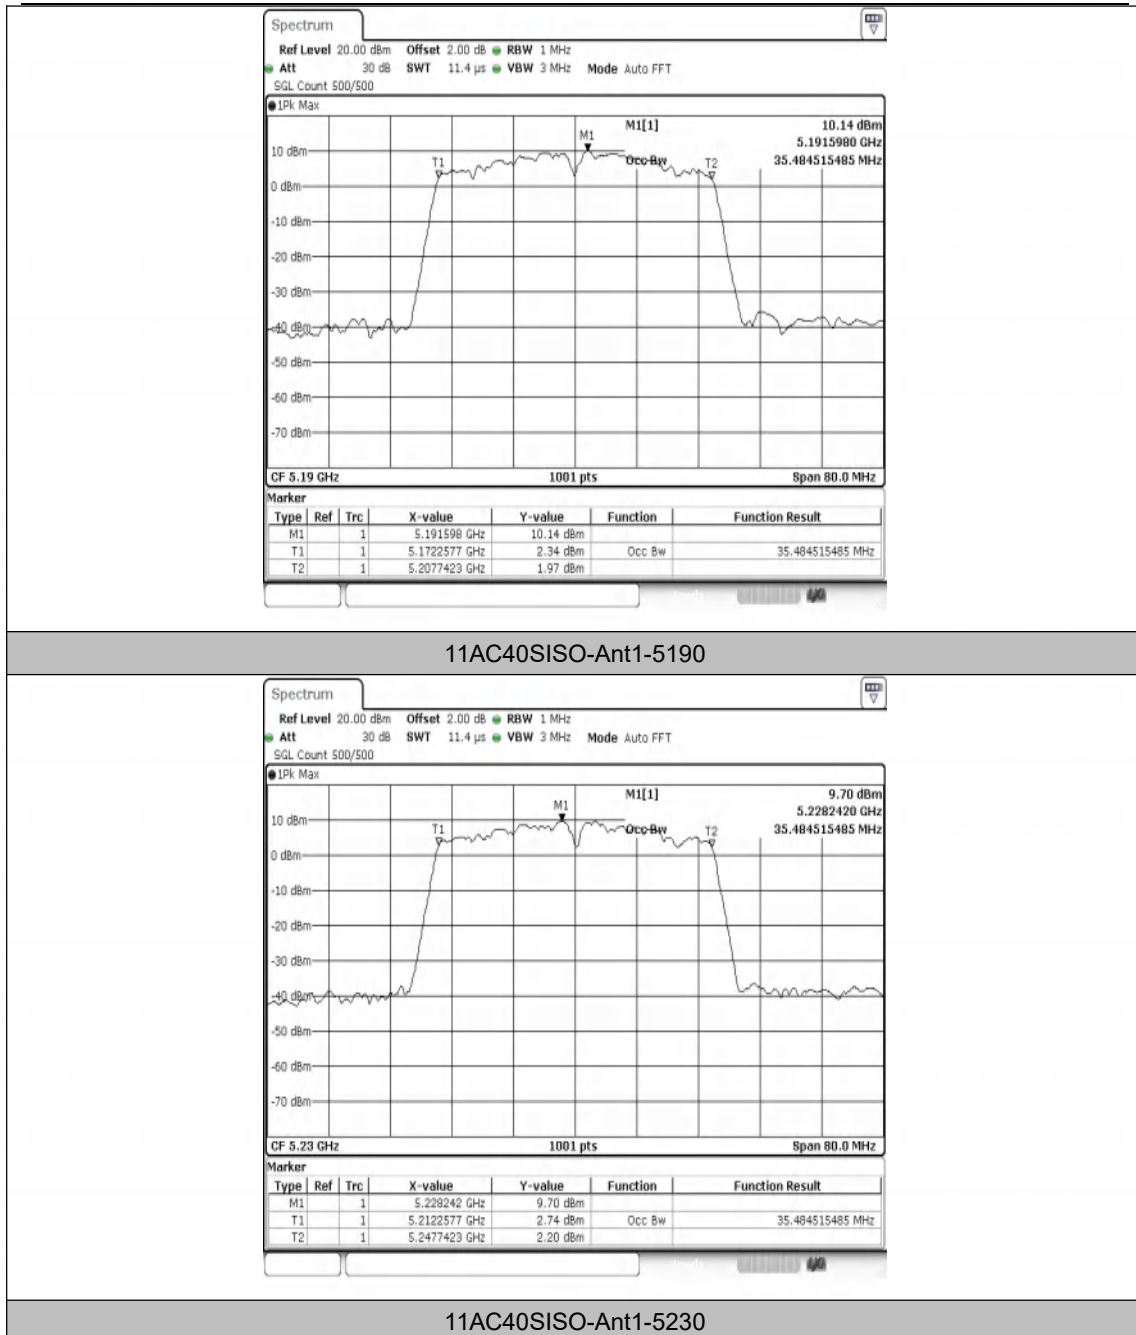


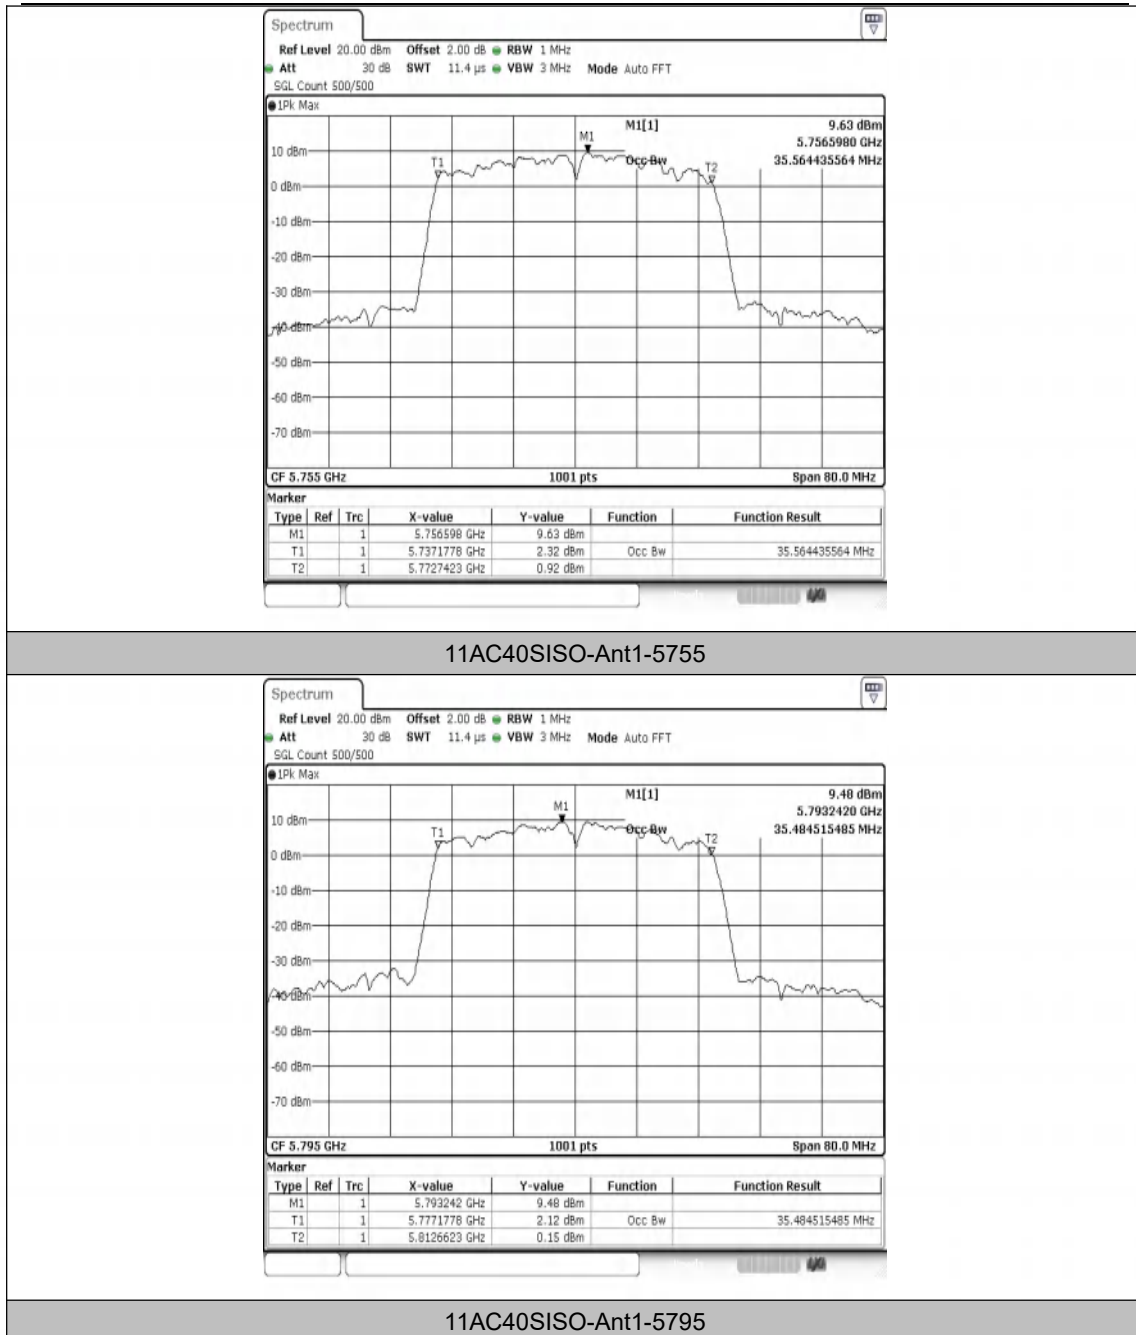




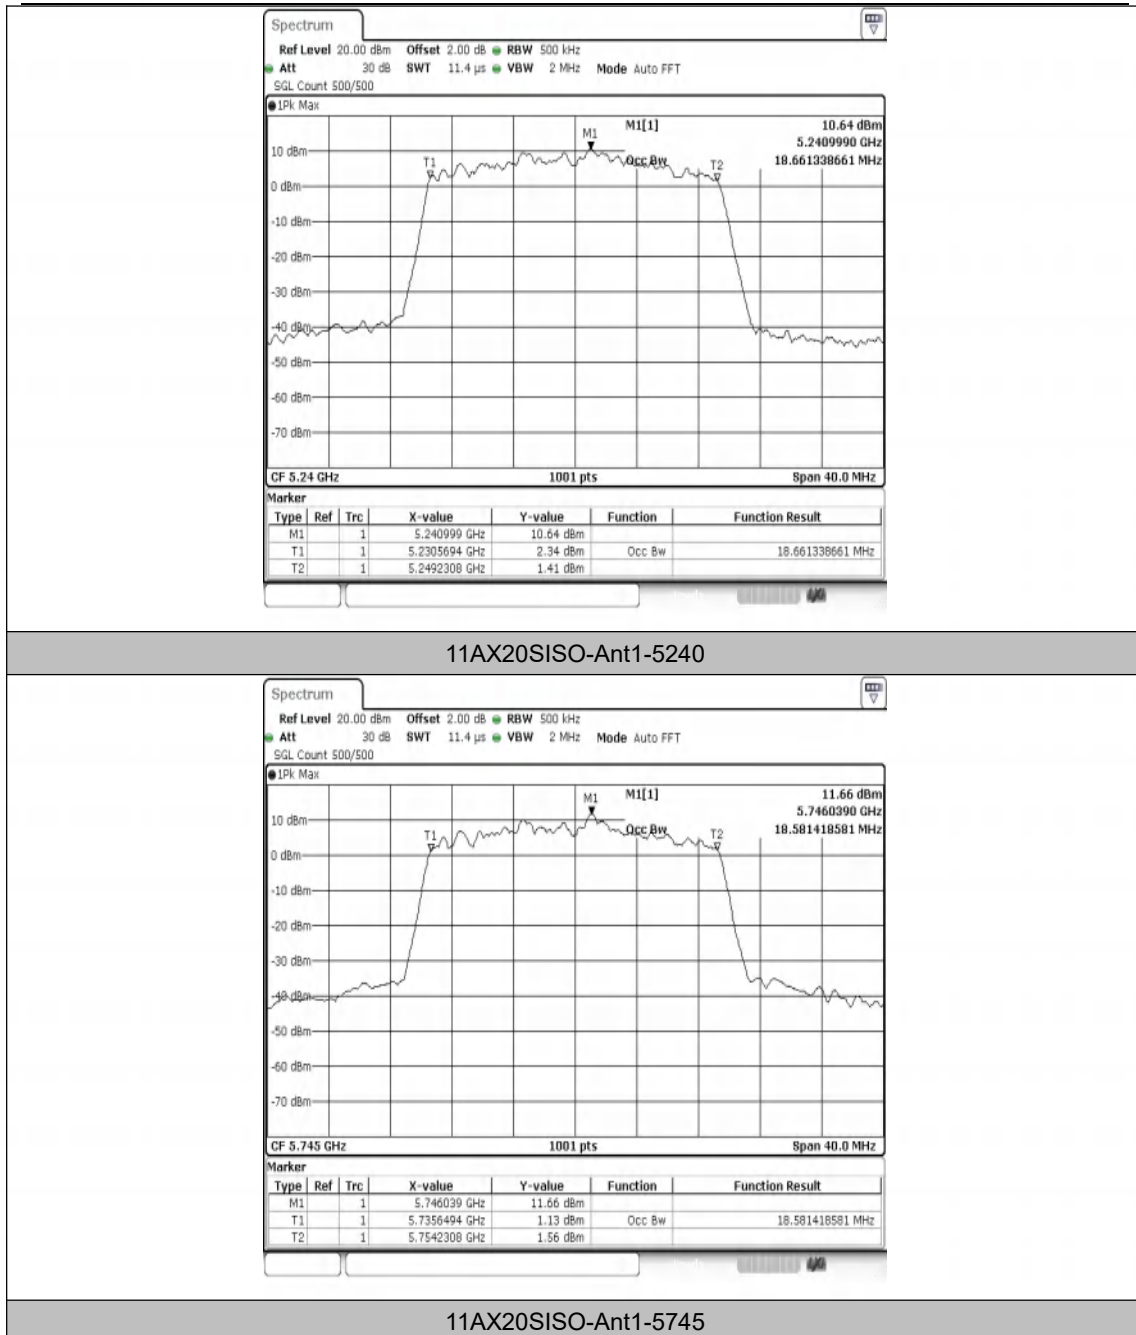

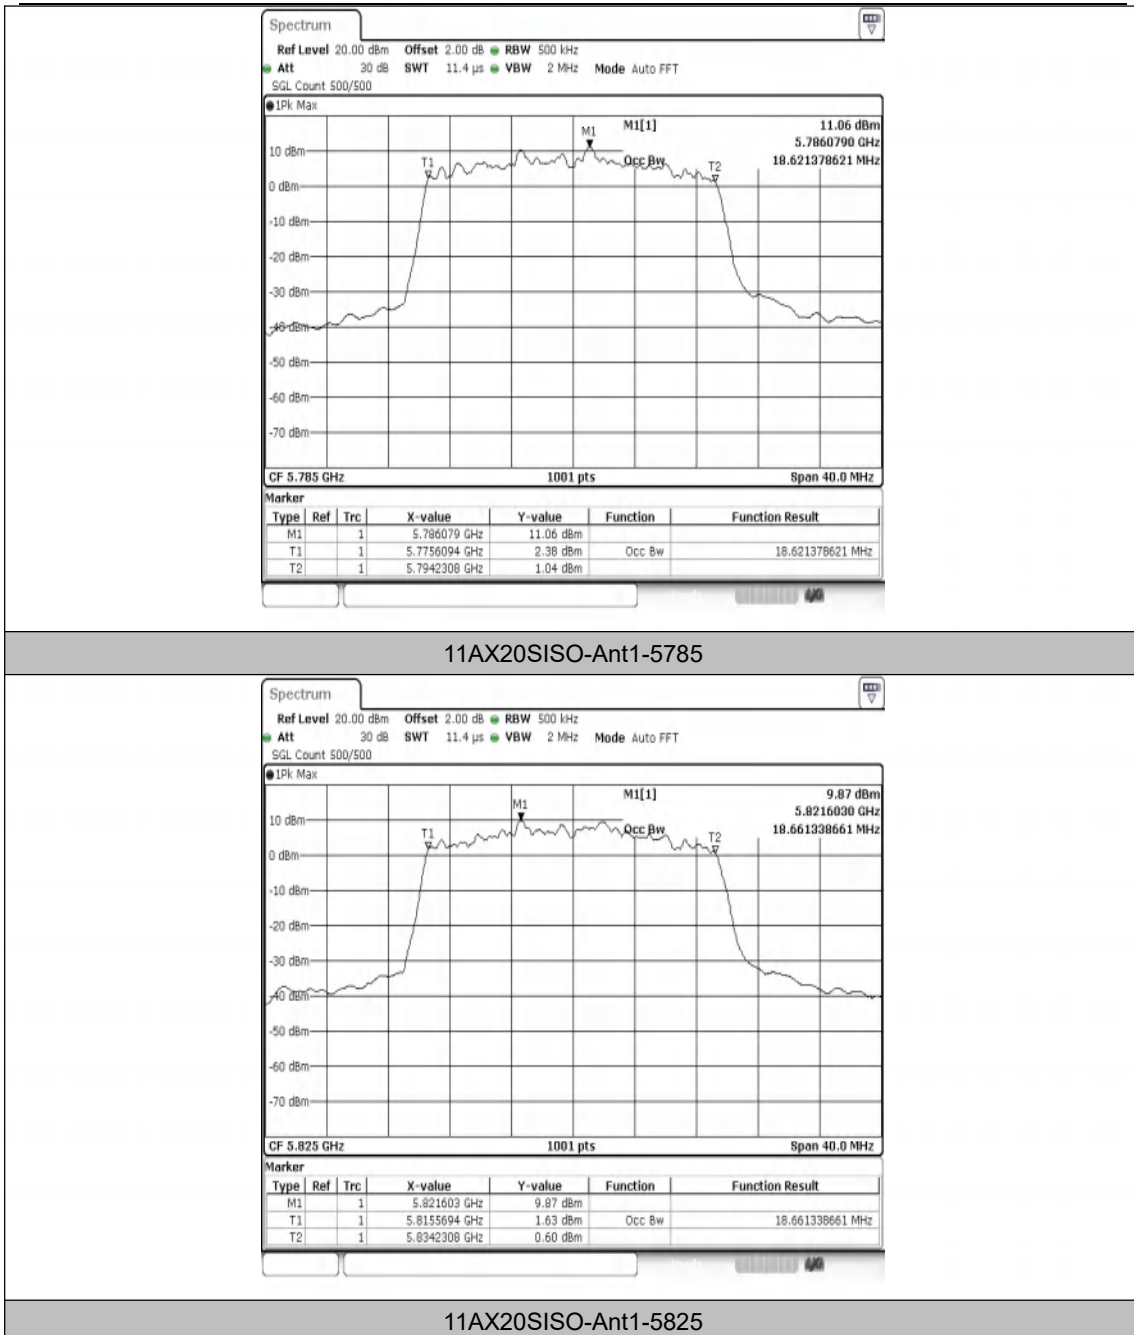

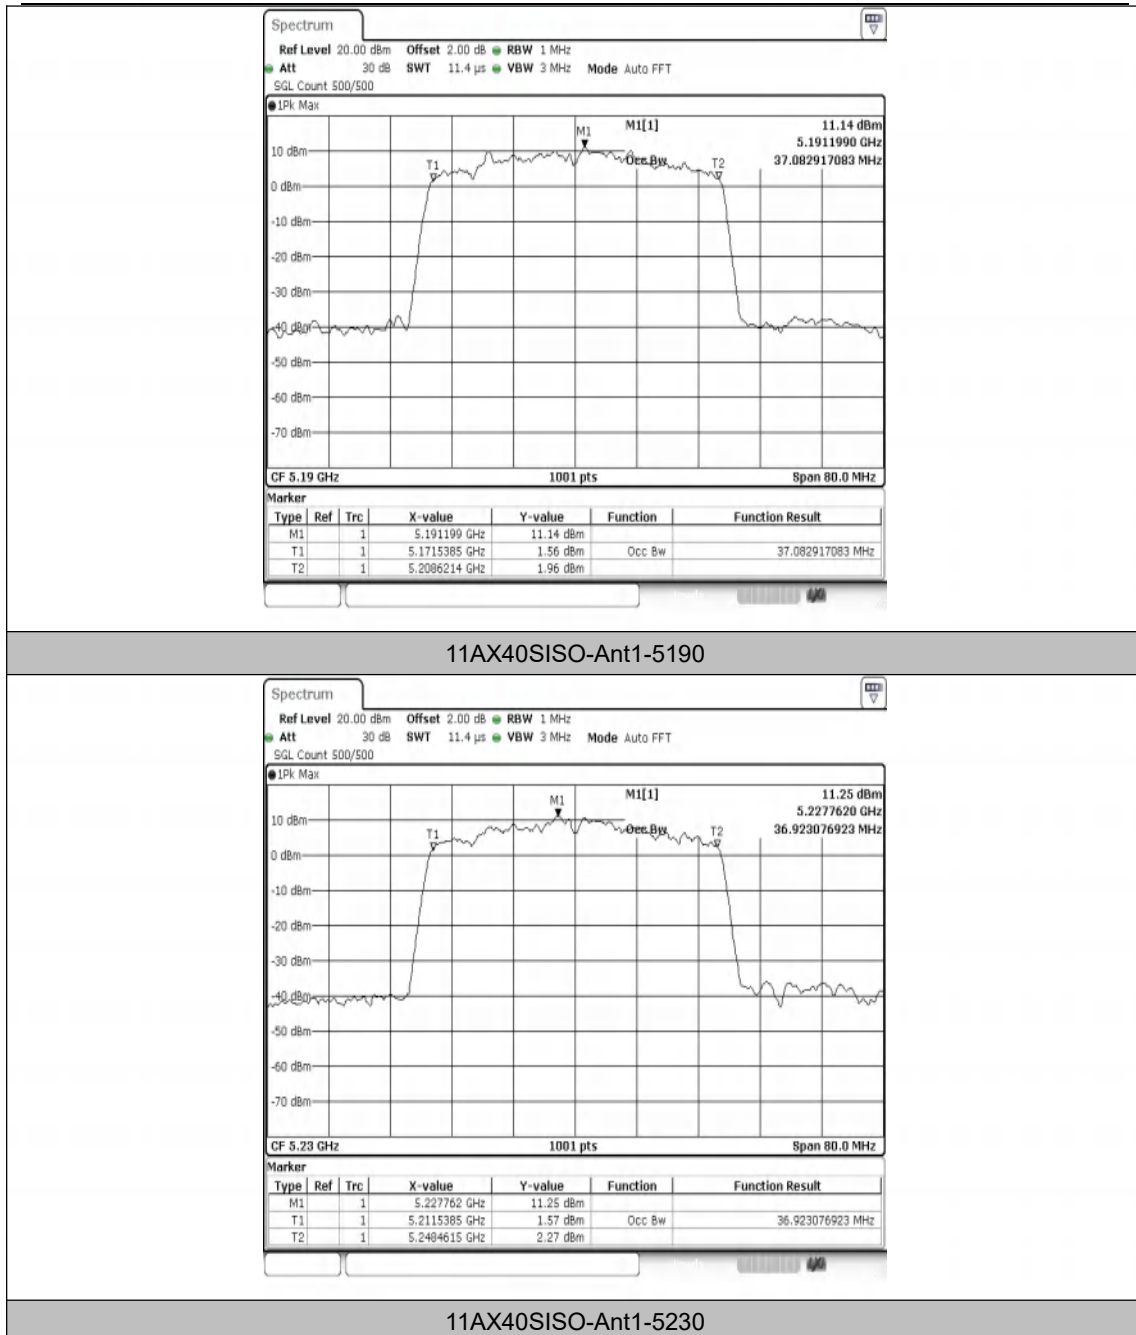

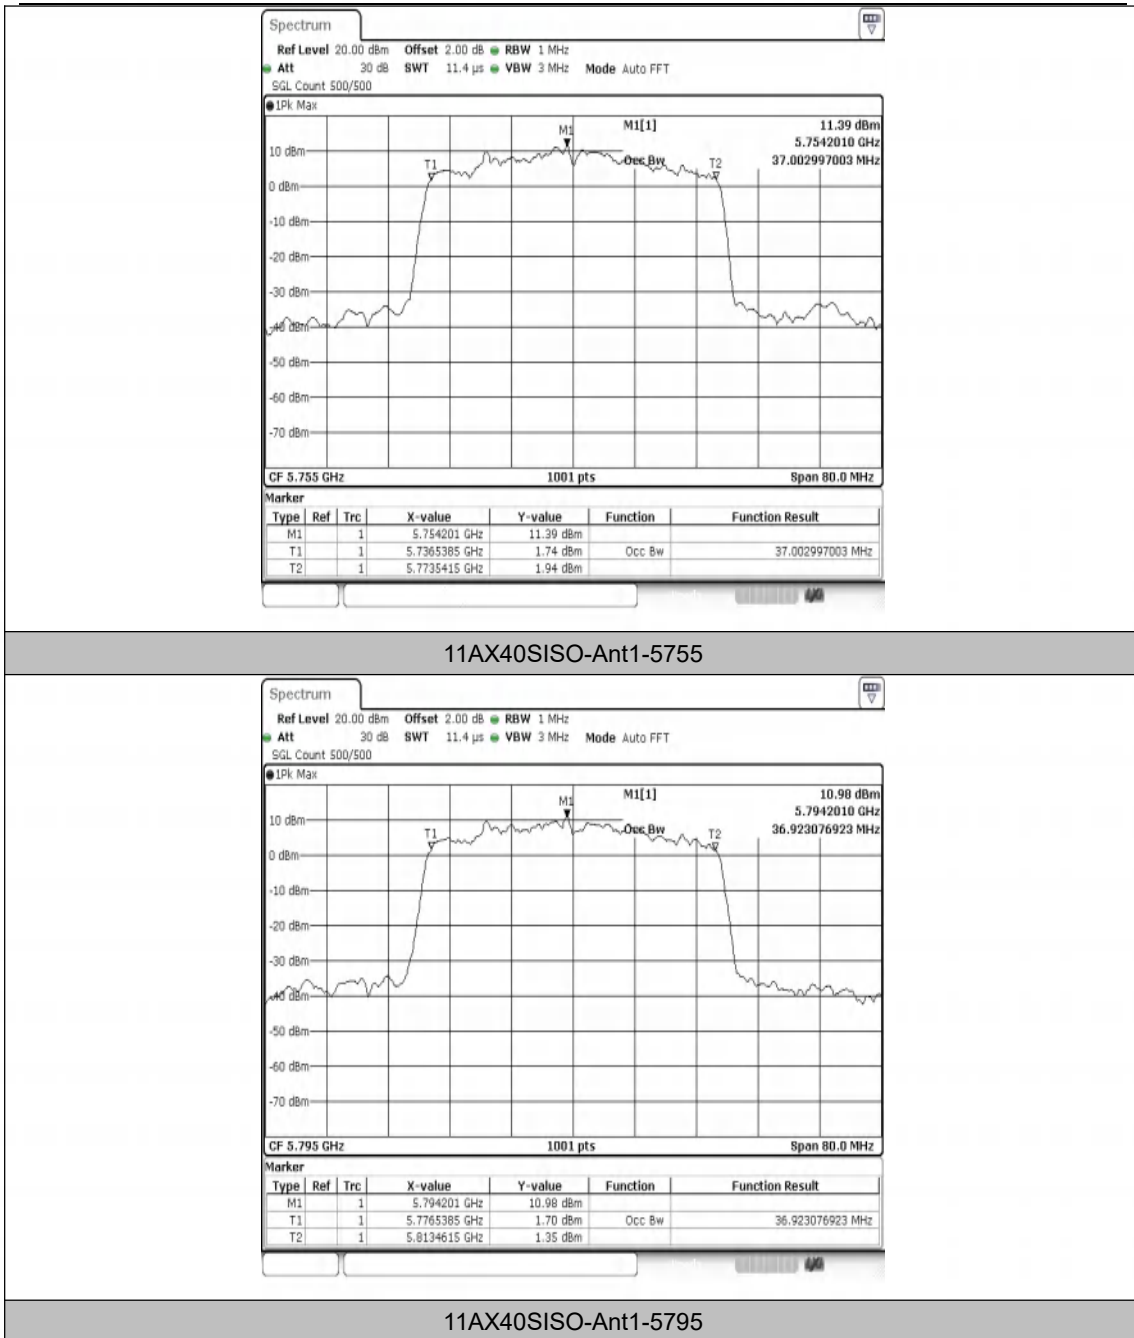

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix A3: Minimum 6dB Bandwidth


Test Result B4


Test Mode	Antenna	Frequency[MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	15.08	5737.44	5752.52	0.5	PASS
11A	Ant1	5785	15.08	5777.44	5792.52	0.5	PASS
11A	Ant1	5825	13.80	5818.68	5832.48	0.5	PASS
11N20SISO	Ant1	5745	15.08	5737.44	5752.52	0.5	PASS
11N20SISO	Ant1	5785	15.08	5777.44	5792.52	0.5	PASS
11N20SISO	Ant1	5825	15.08	5817.44	5832.52	0.5	PASS
11N40SISO	Ant1	5755	33.84	5738.68	5772.52	0.5	PASS
11N40SISO	Ant1	5795	33.84	5778.68	5812.52	0.5	PASS
11AC20SISO	Ant1	5745	15.08	5737.44	5752.52	0.5	PASS
11AC20SISO	Ant1	5785	15.08	5777.44	5792.52	0.5	PASS
11AC20SISO	Ant1	5825	15.08	5817.44	5832.52	0.5	PASS
11AC40SISO	Ant1	5755	33.84	5738.68	5772.52	0.5	PASS
11AC40SISO	Ant1	5795	33.84	5778.68	5812.52	0.5	PASS
11AX20SISO	Ant1	5745	13.84	5738.68	5752.52	0.5	PASS
11AX20SISO	Ant1	5785	15.04	5777.48	5792.52	0.5	PASS
11AX20SISO	Ant1	5825	15.08	5817.44	5832.52	0.5	PASS
11AX40SISO	Ant1	5755	35.04	5737.48	5772.52	0.5	PASS
11AX40SISO	Ant1	5795	31.36	5778.68	5810.04	0.5	PASS


Test Graphs B4

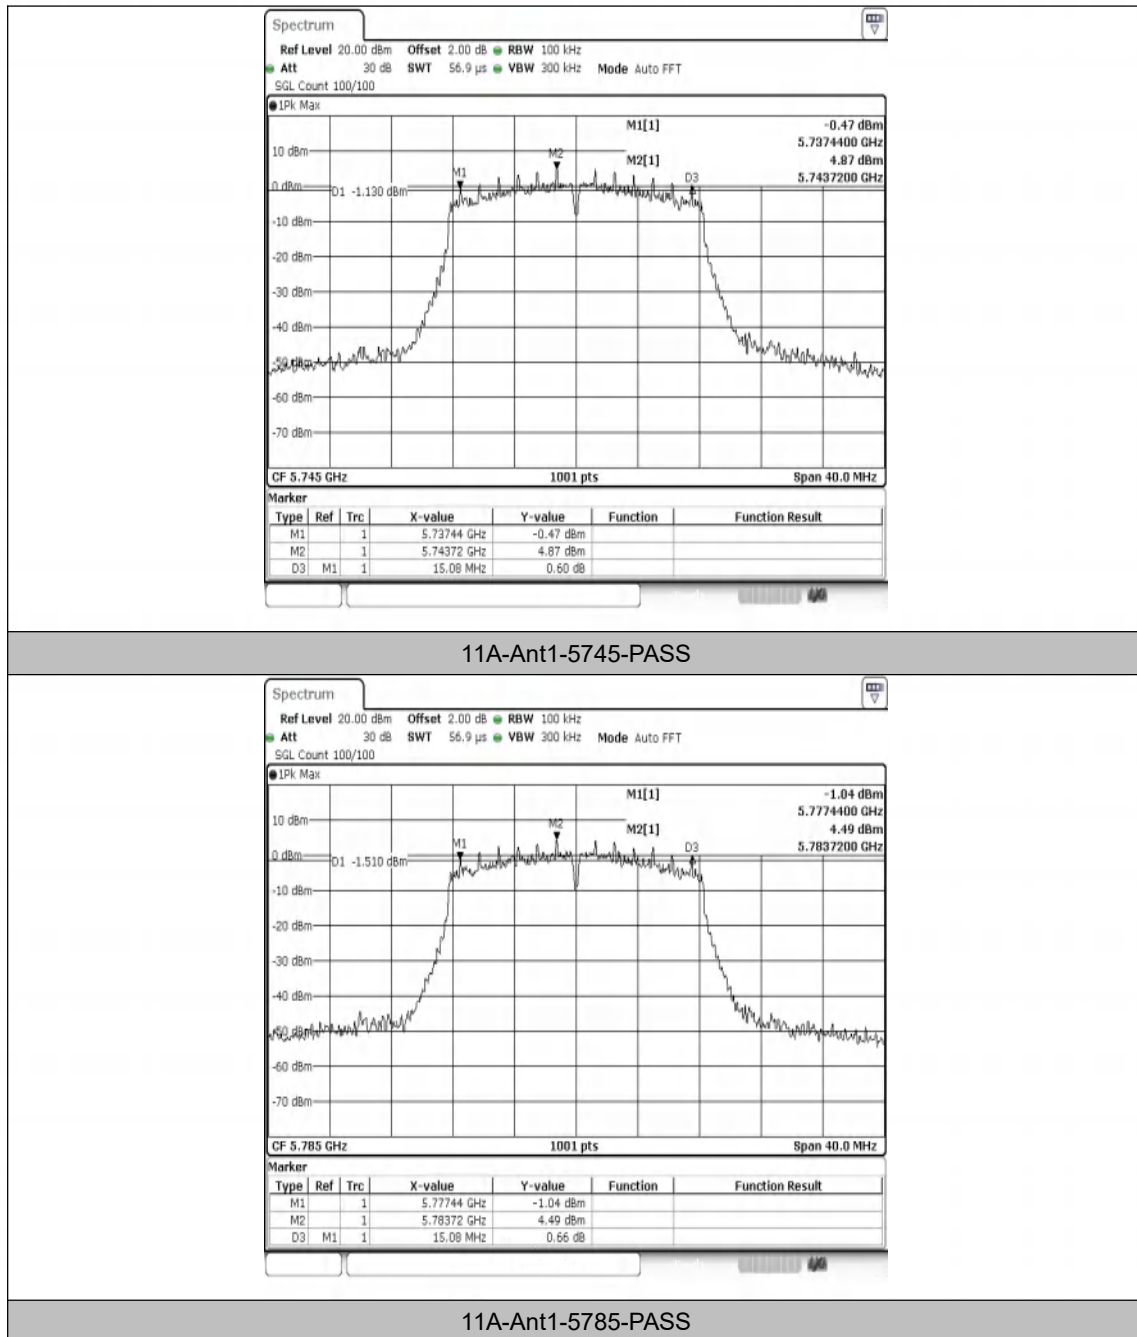


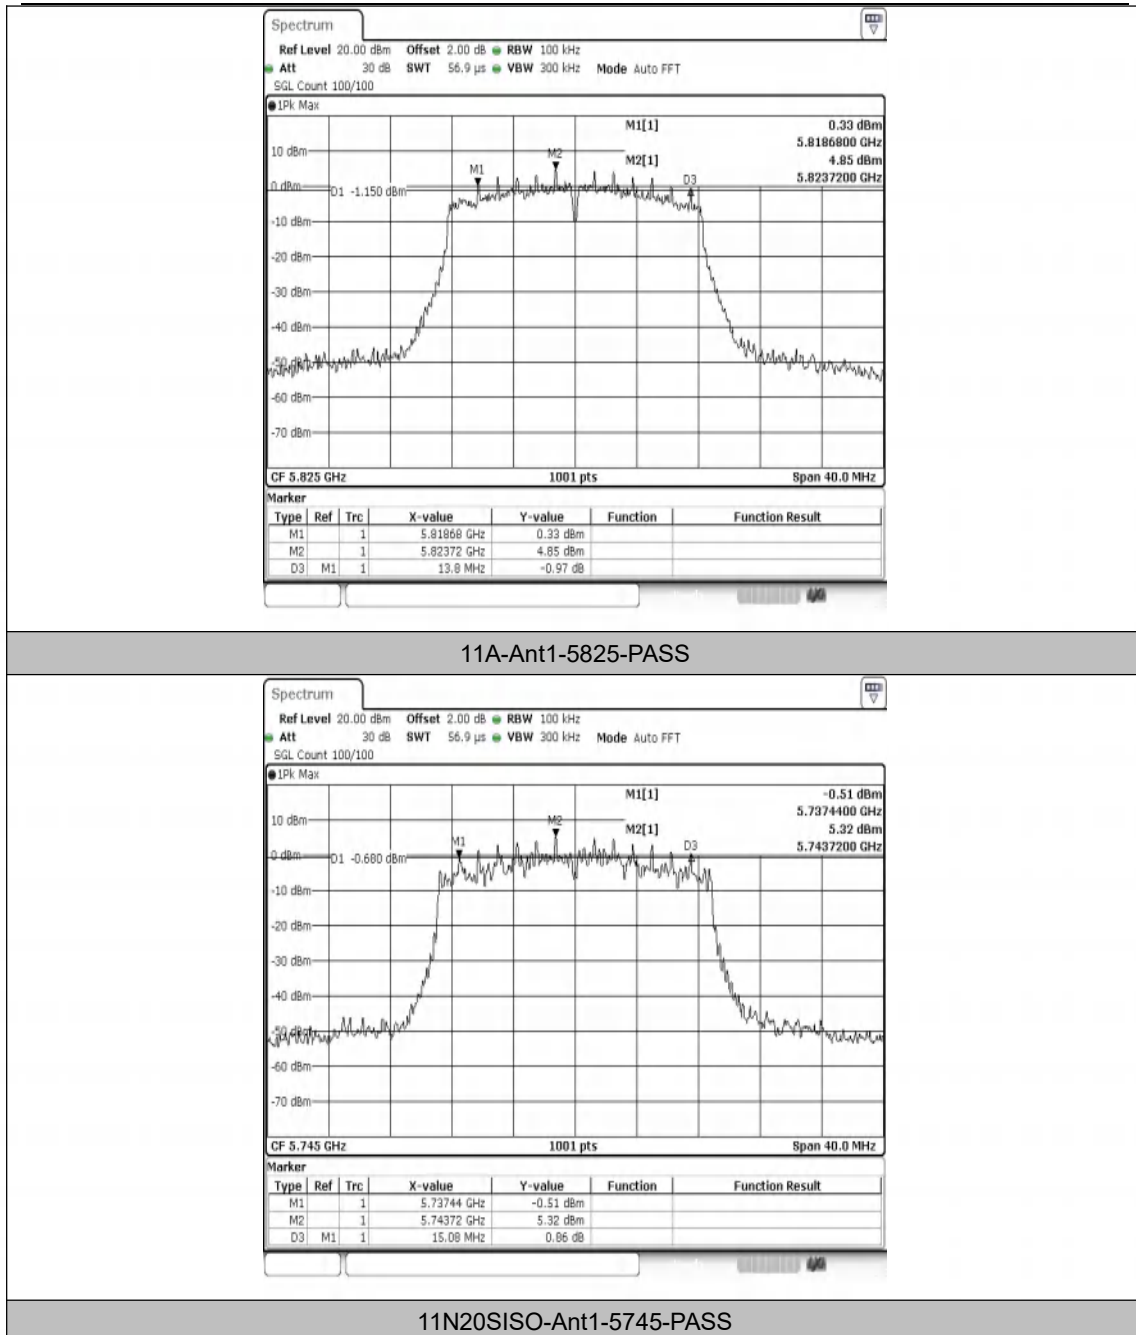


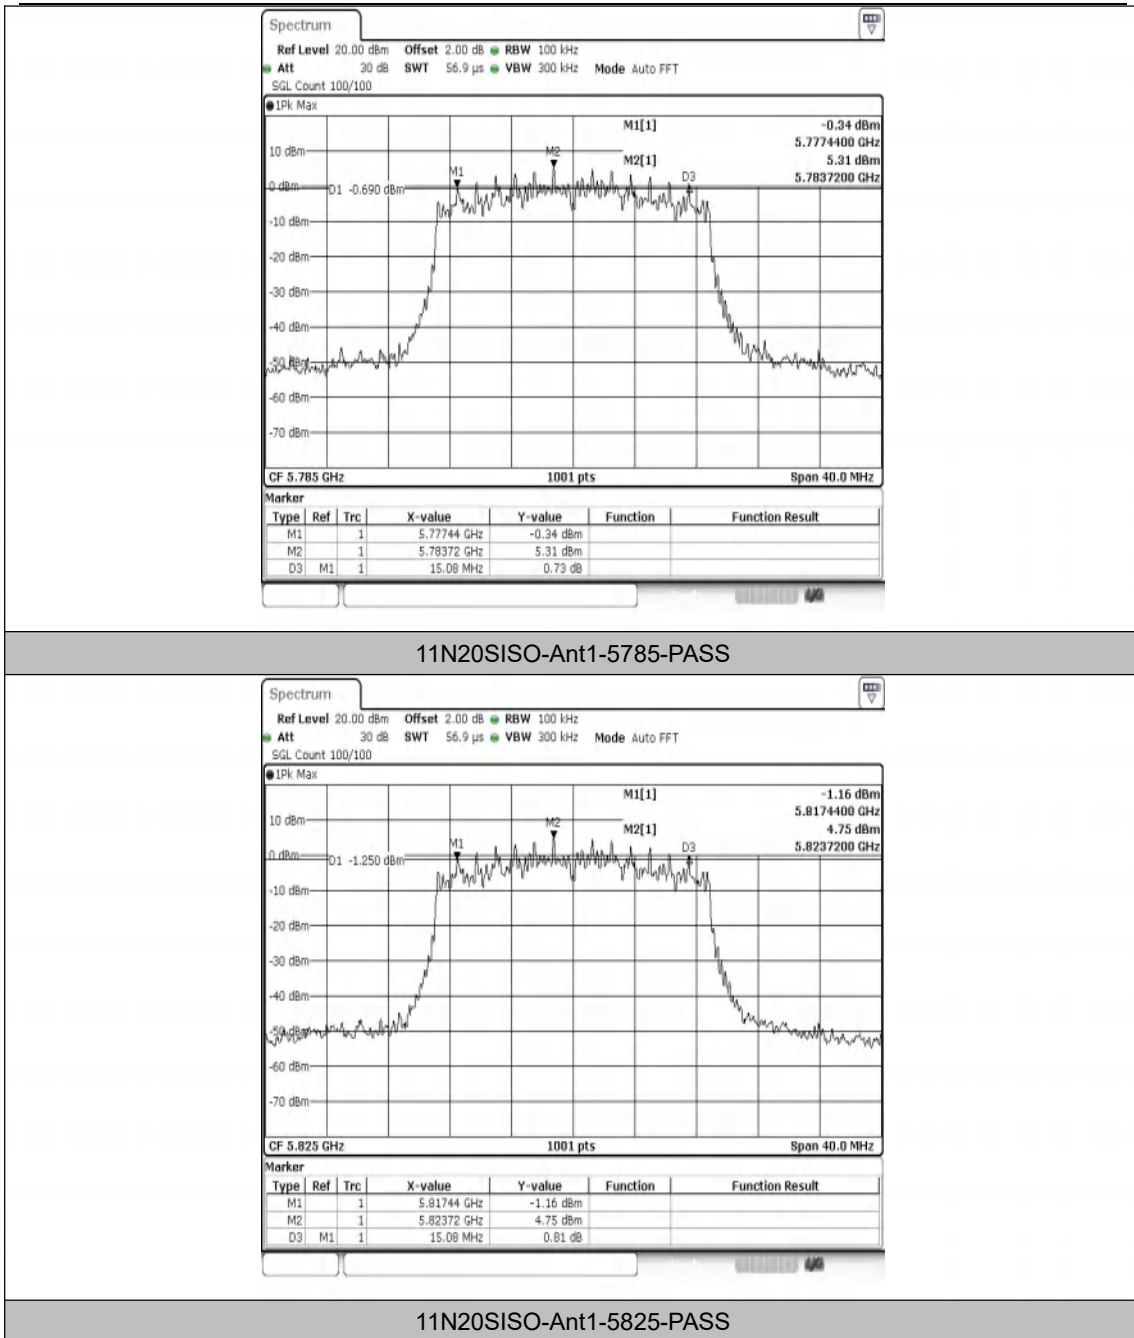

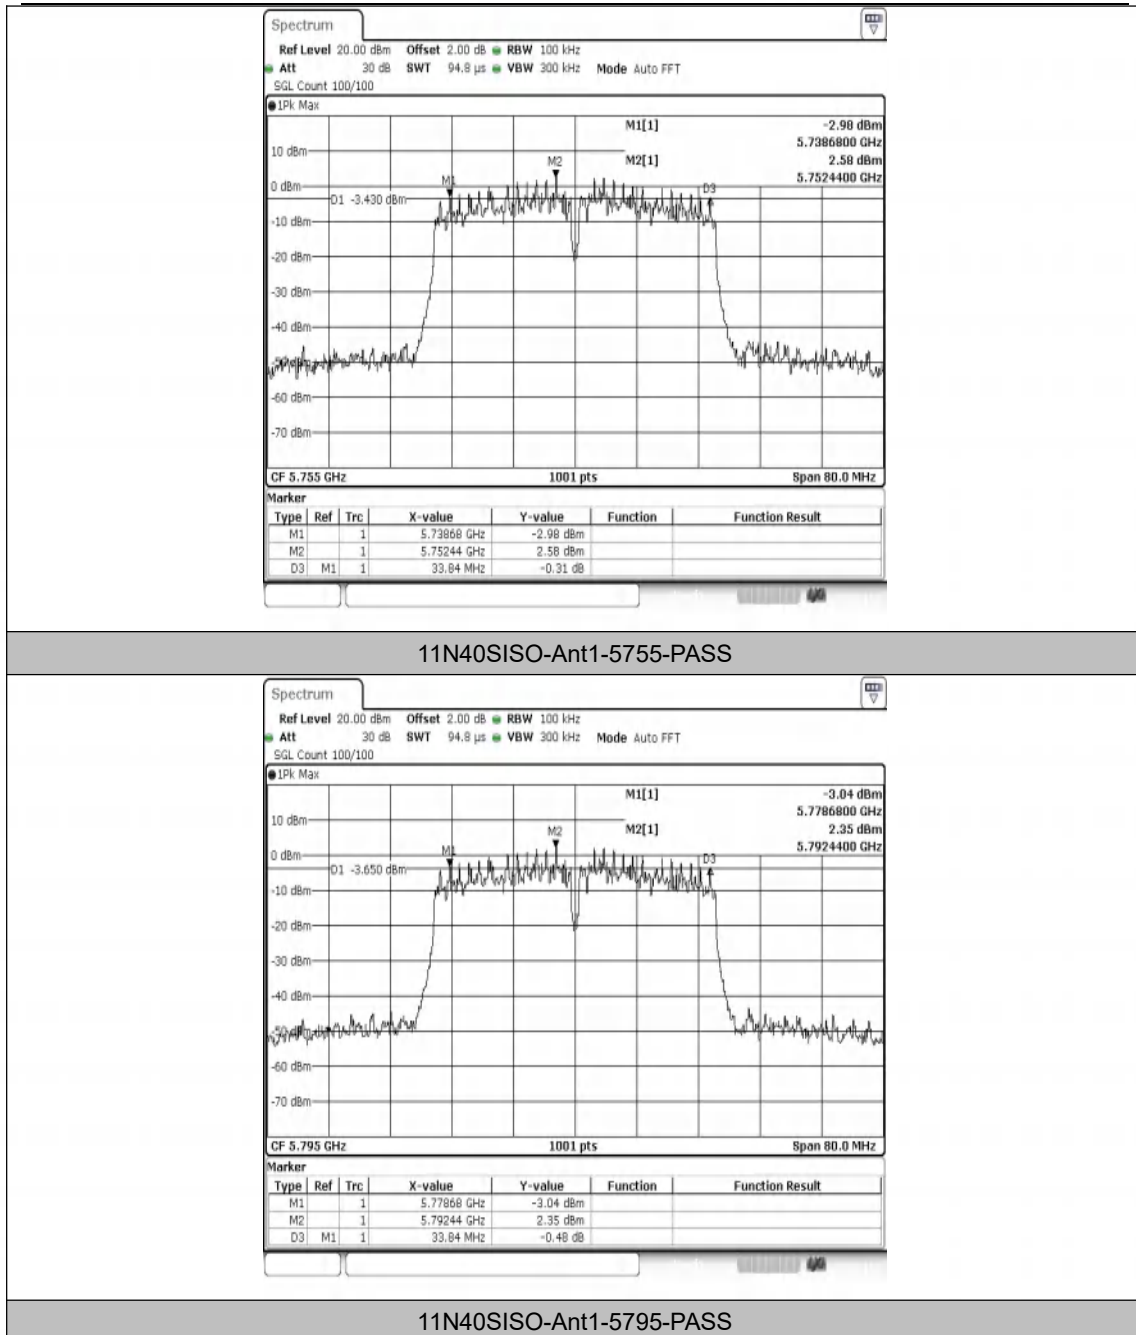


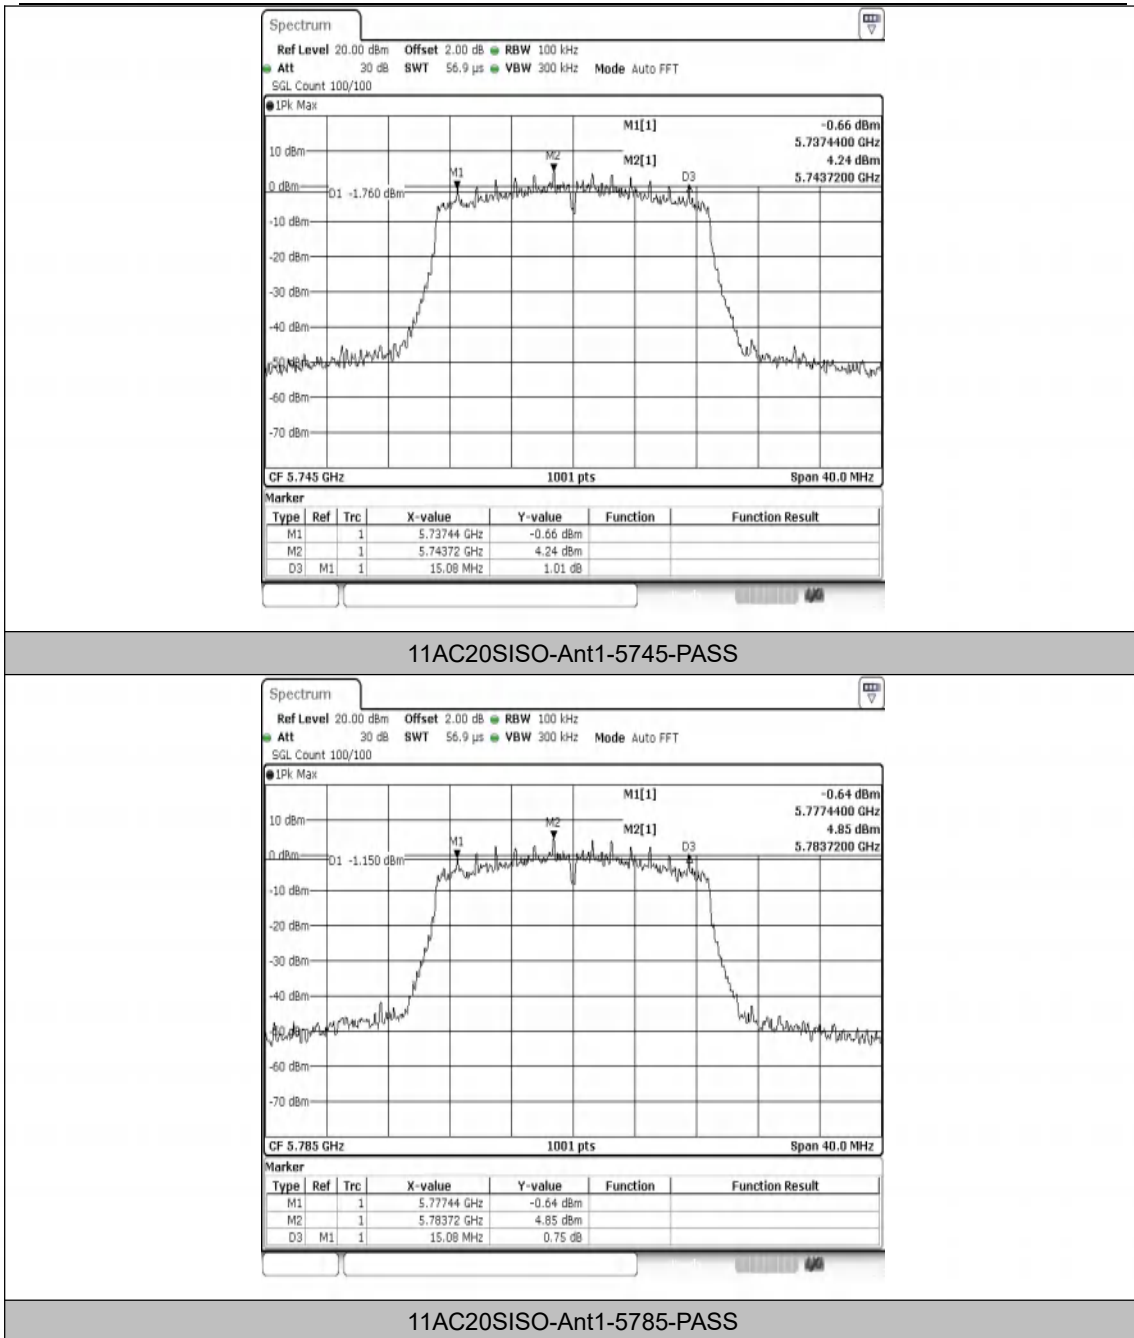

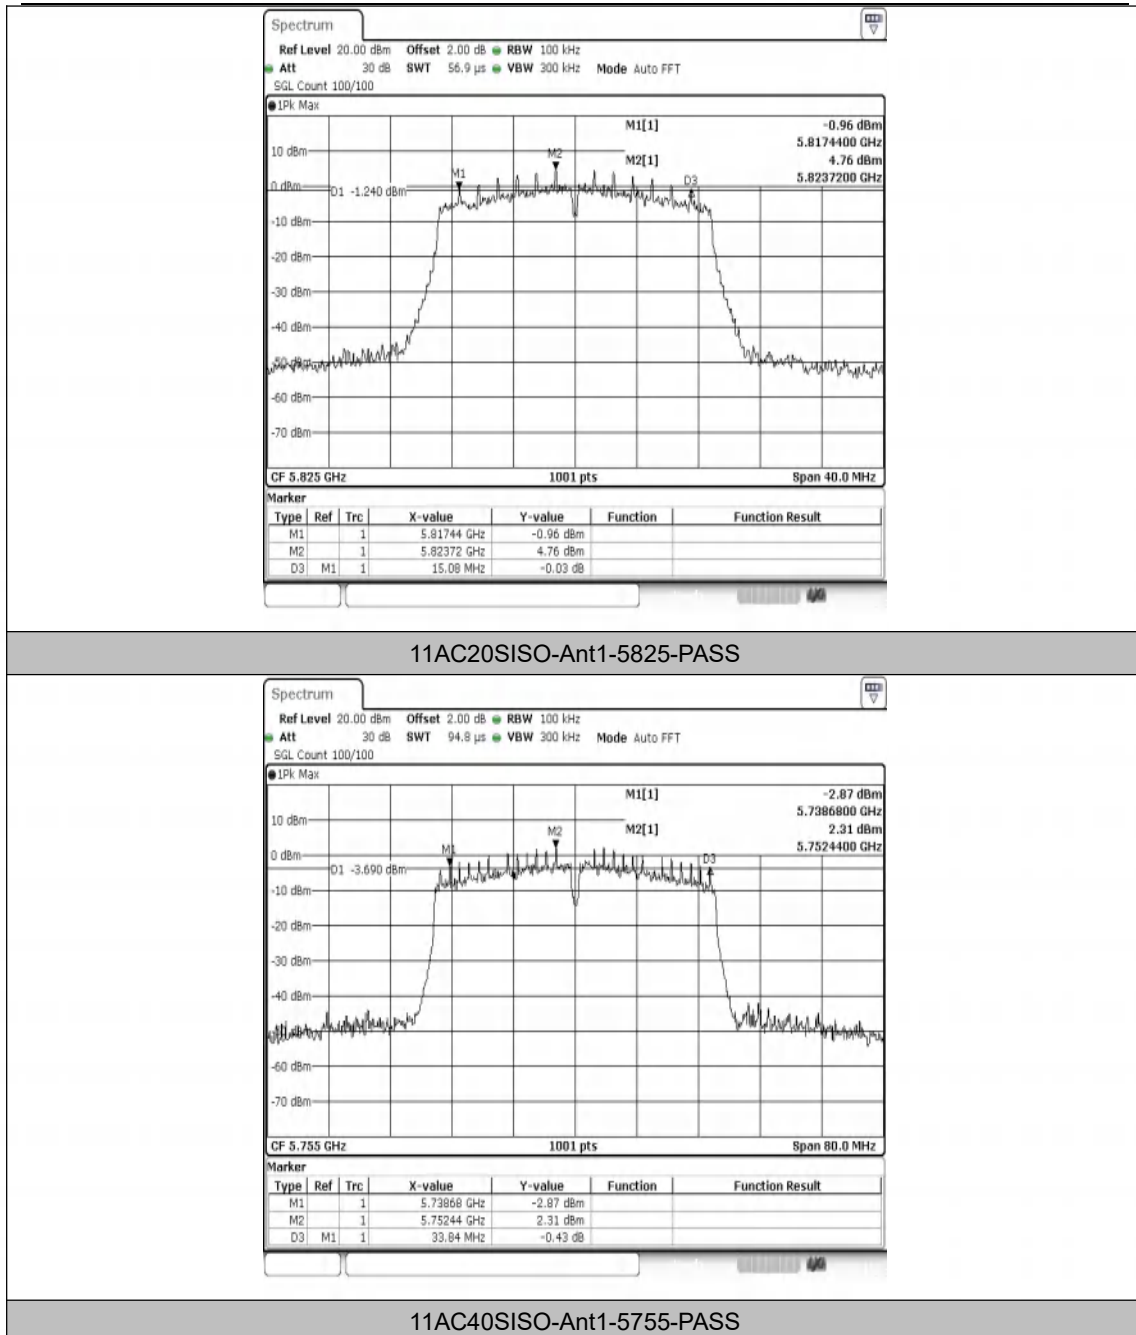


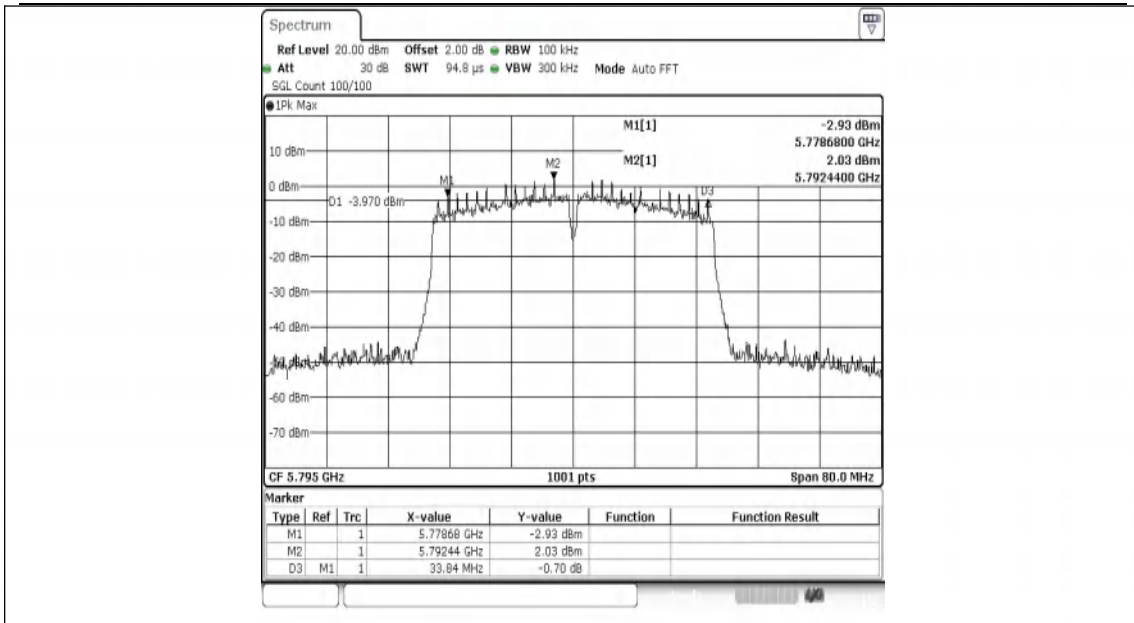


11AC40SISO-Ant1-5795-PASS

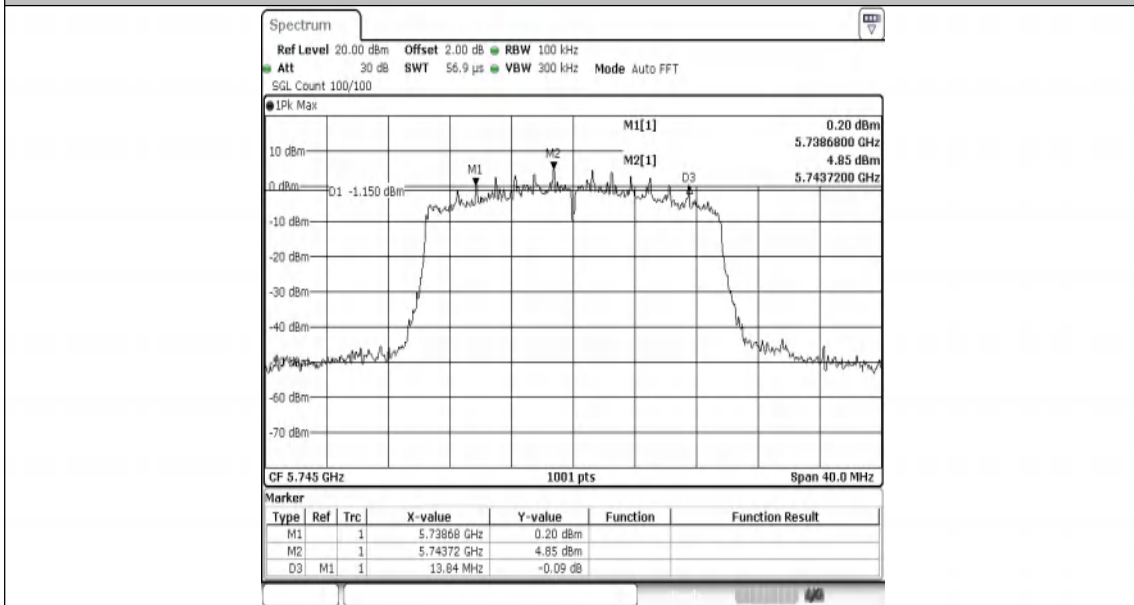


11AX20SISO-Ant1-5745-PASS

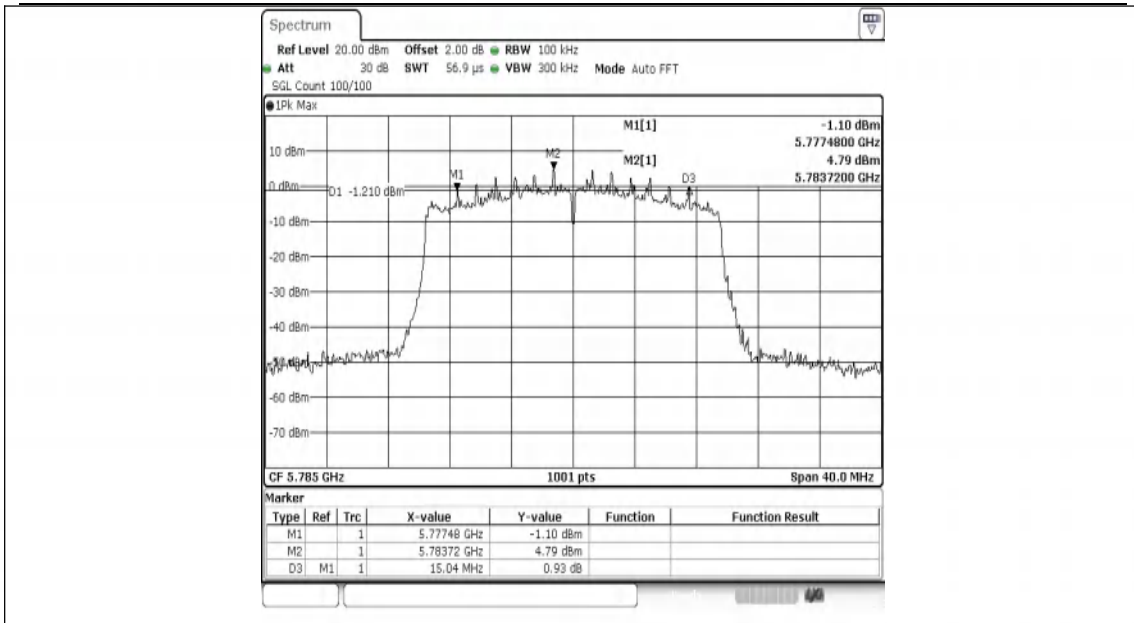

11AX20SISO-Ant1-5785-PASS

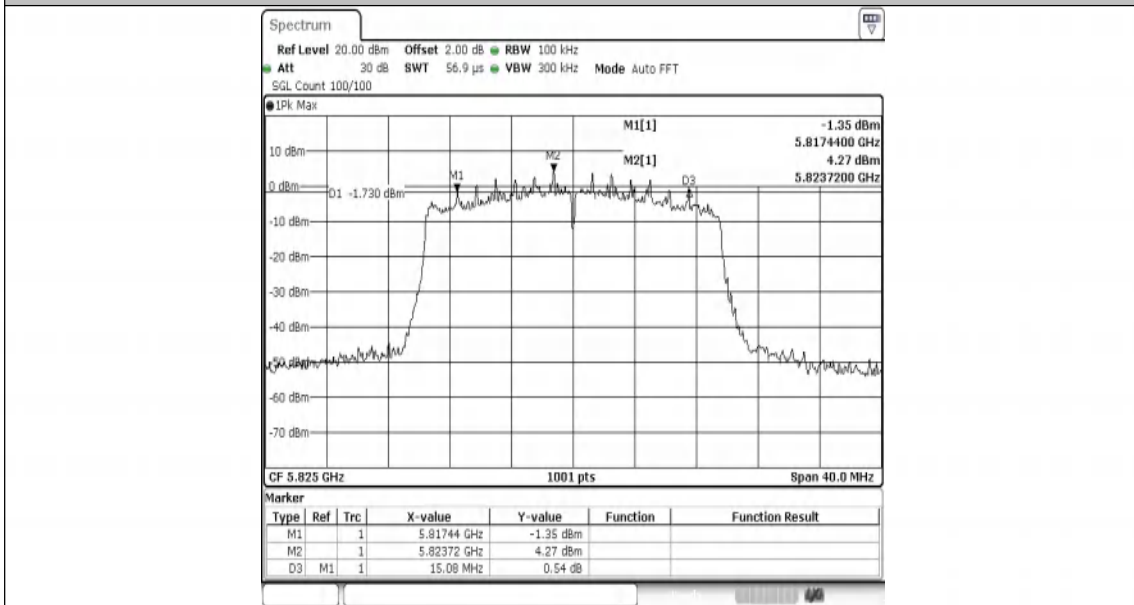

11AX20SISO-Ant1-5825-PASS

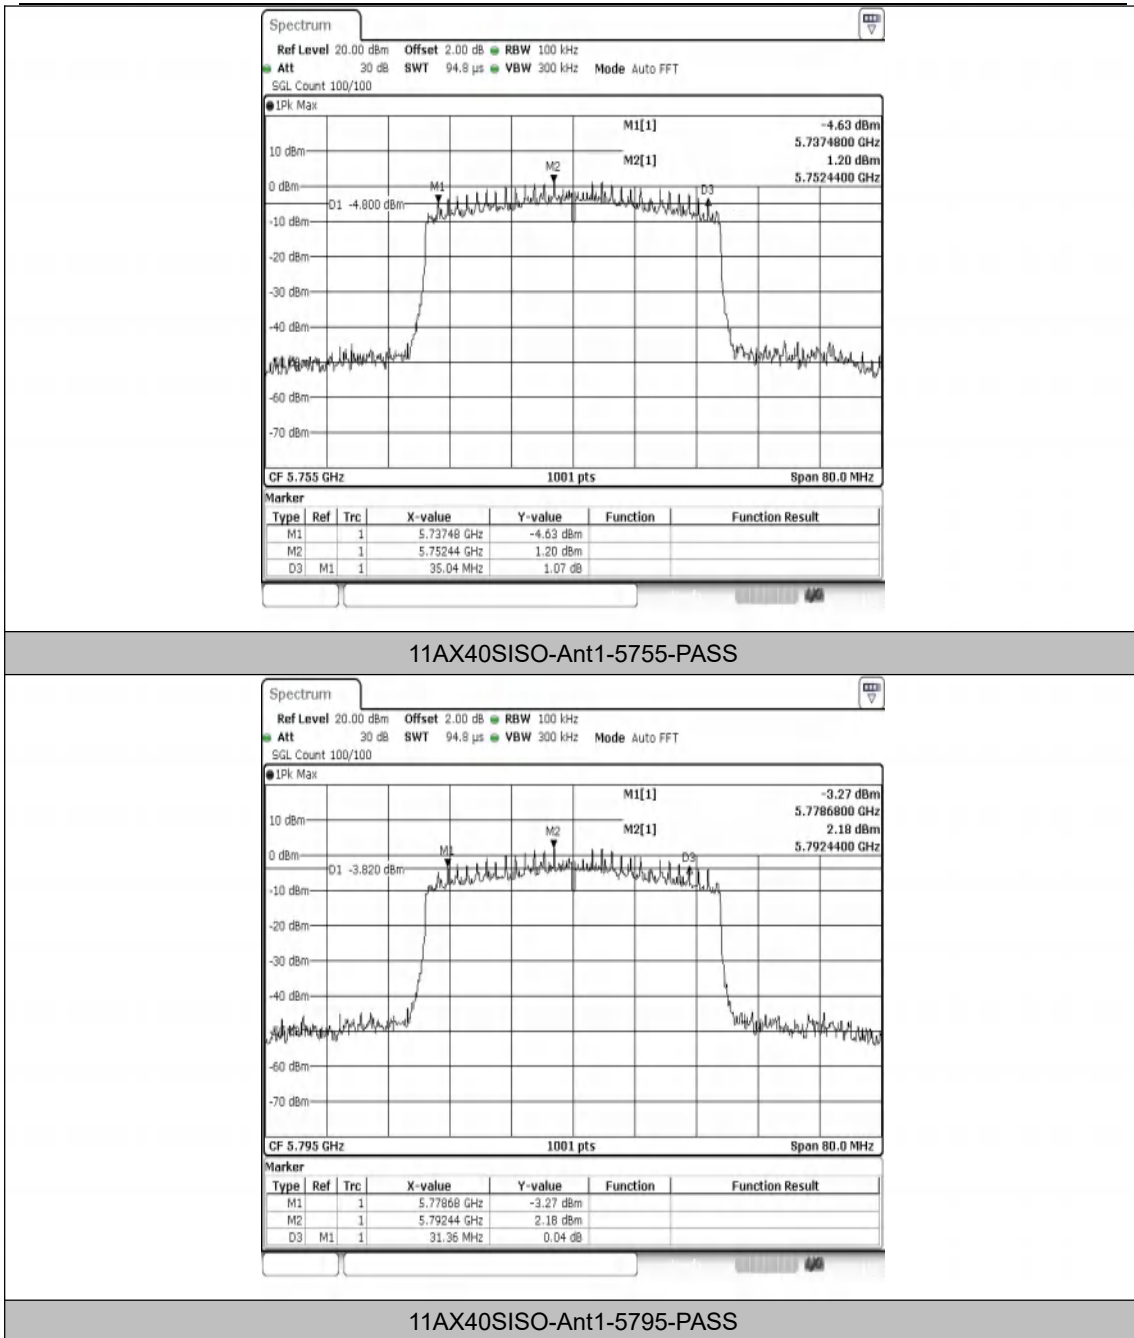


Appendix B: Duty Cycle

Test Result

Test Mode	Antenna	Frequency[MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Dc Factor [dB]	1/T
11A	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5200	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5200	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5190	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5230	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5200	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5190	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5230	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5200	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5190	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5230	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01


Test Graphs

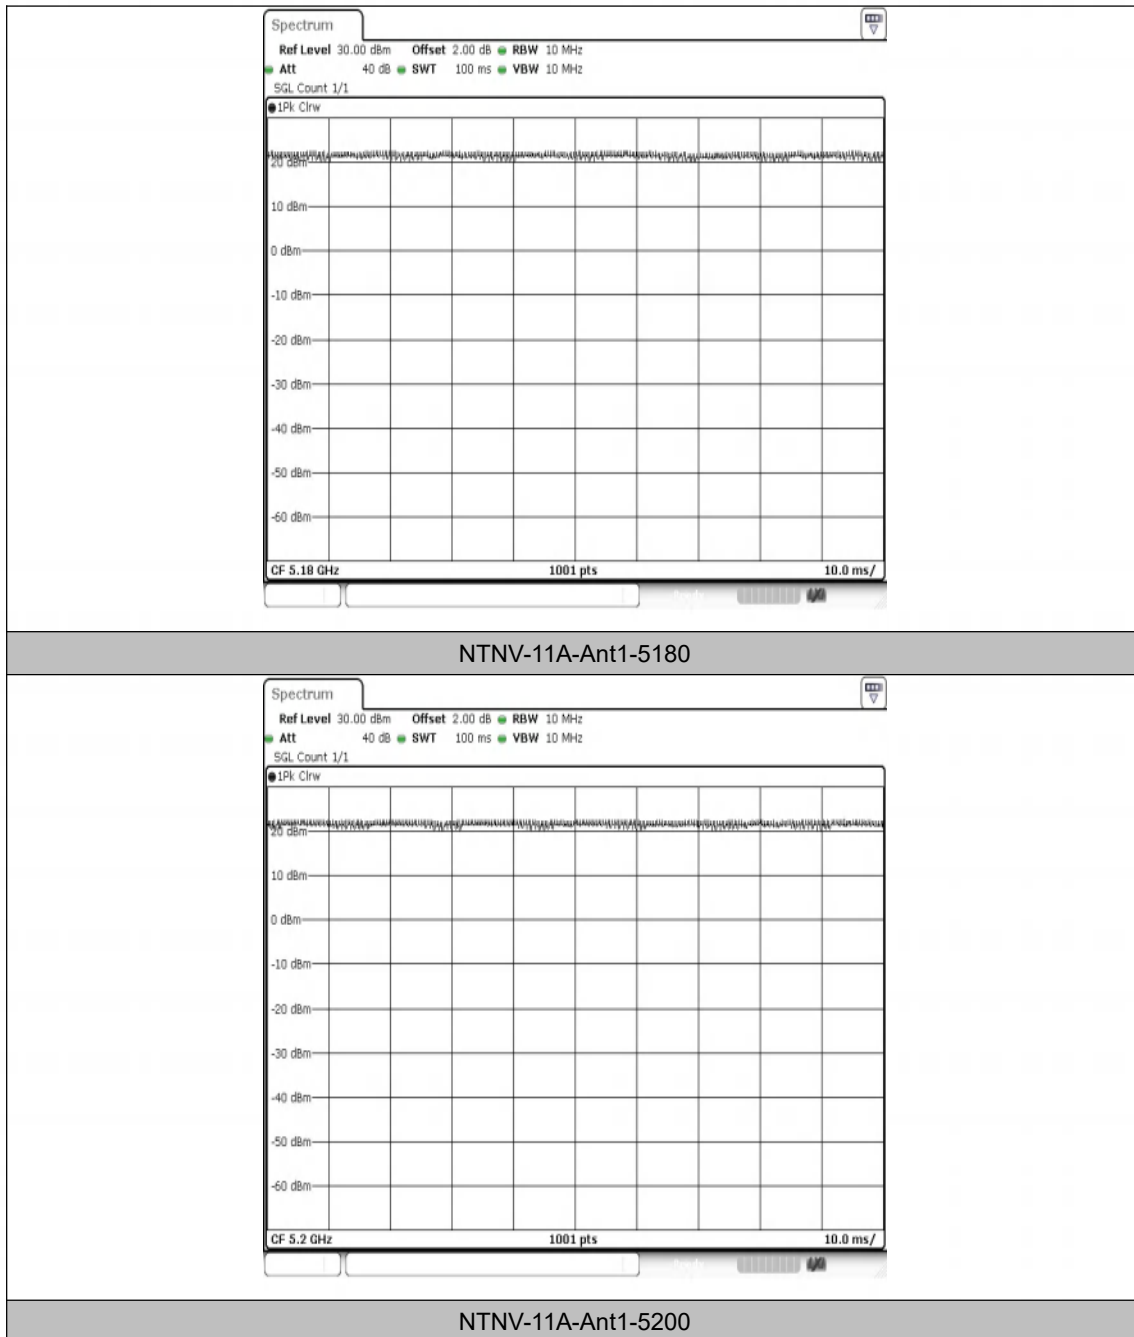

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

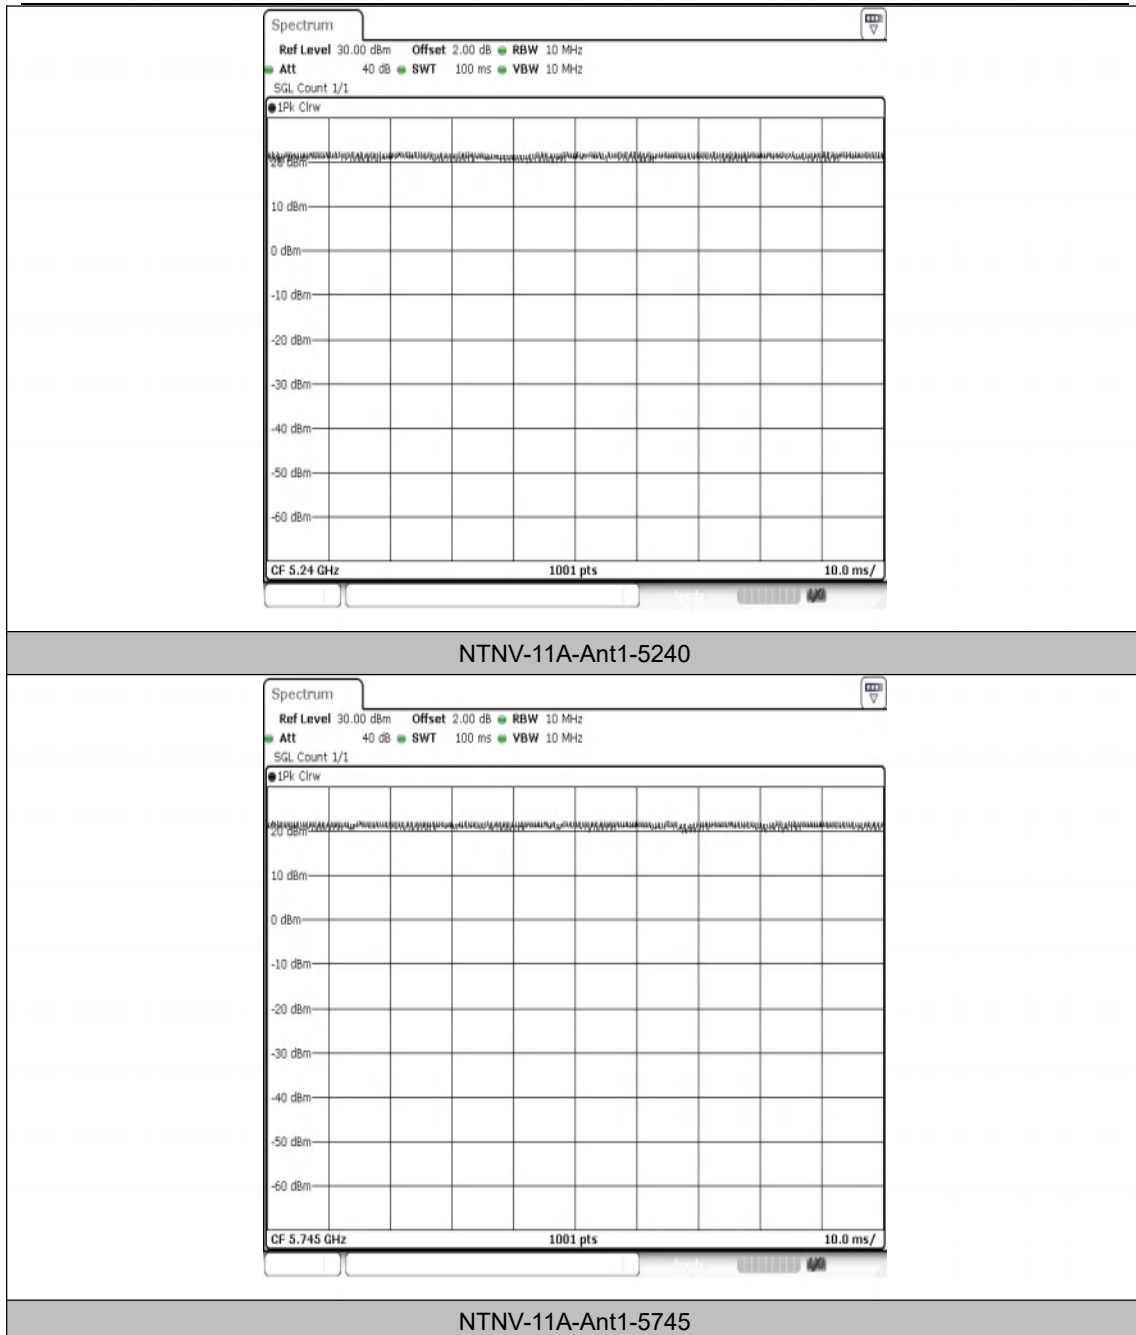

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

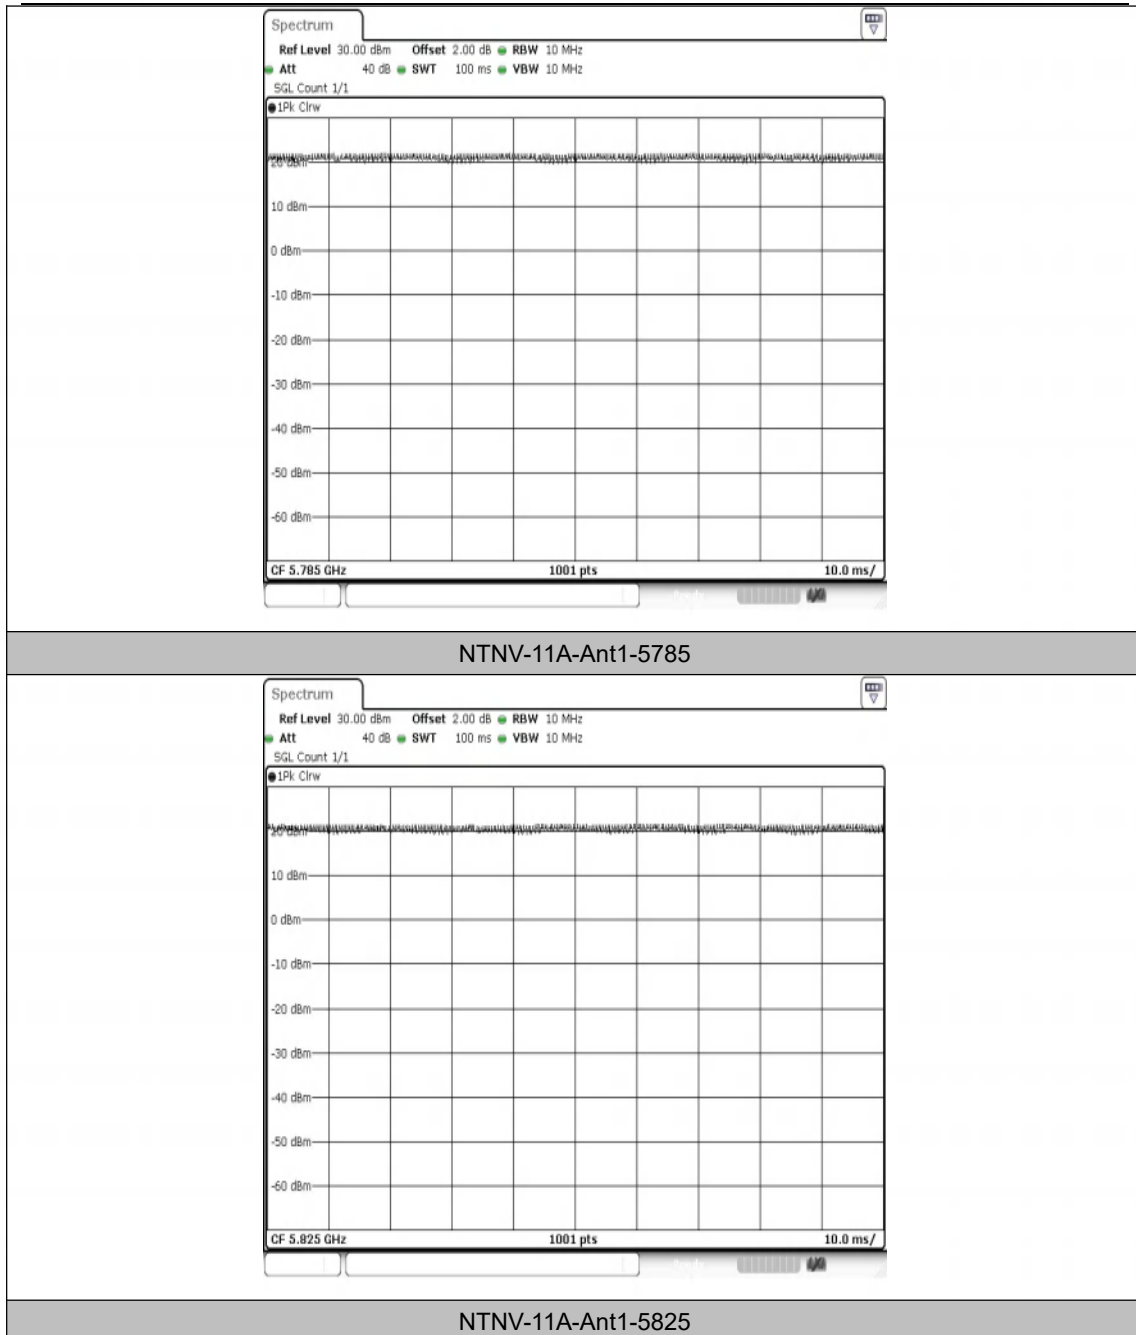

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

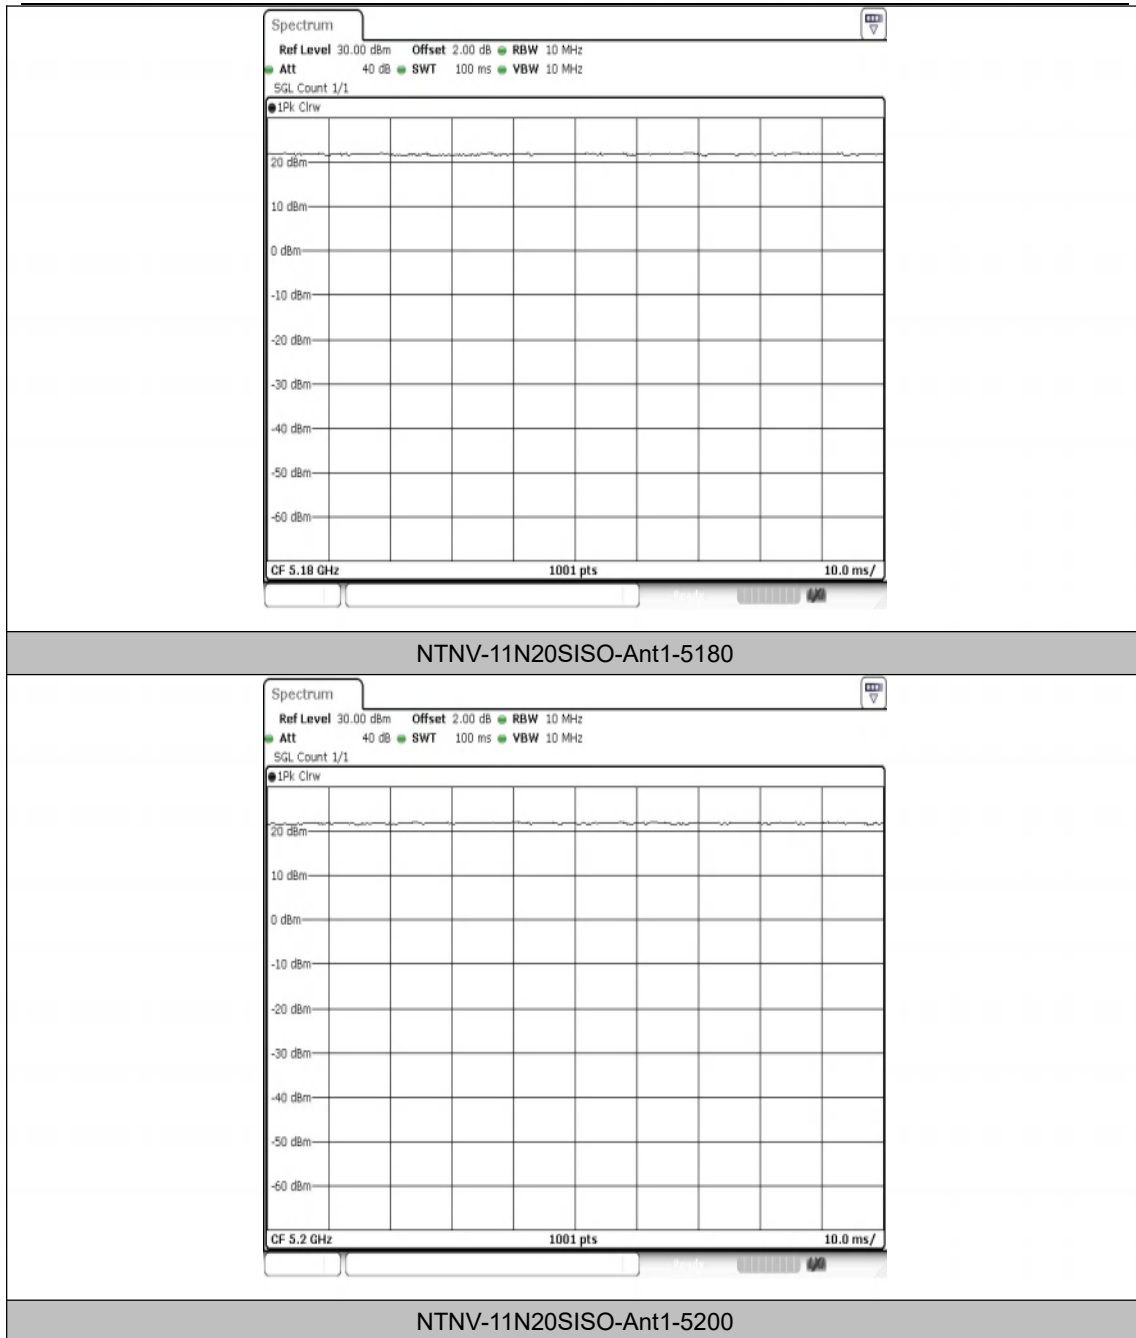

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

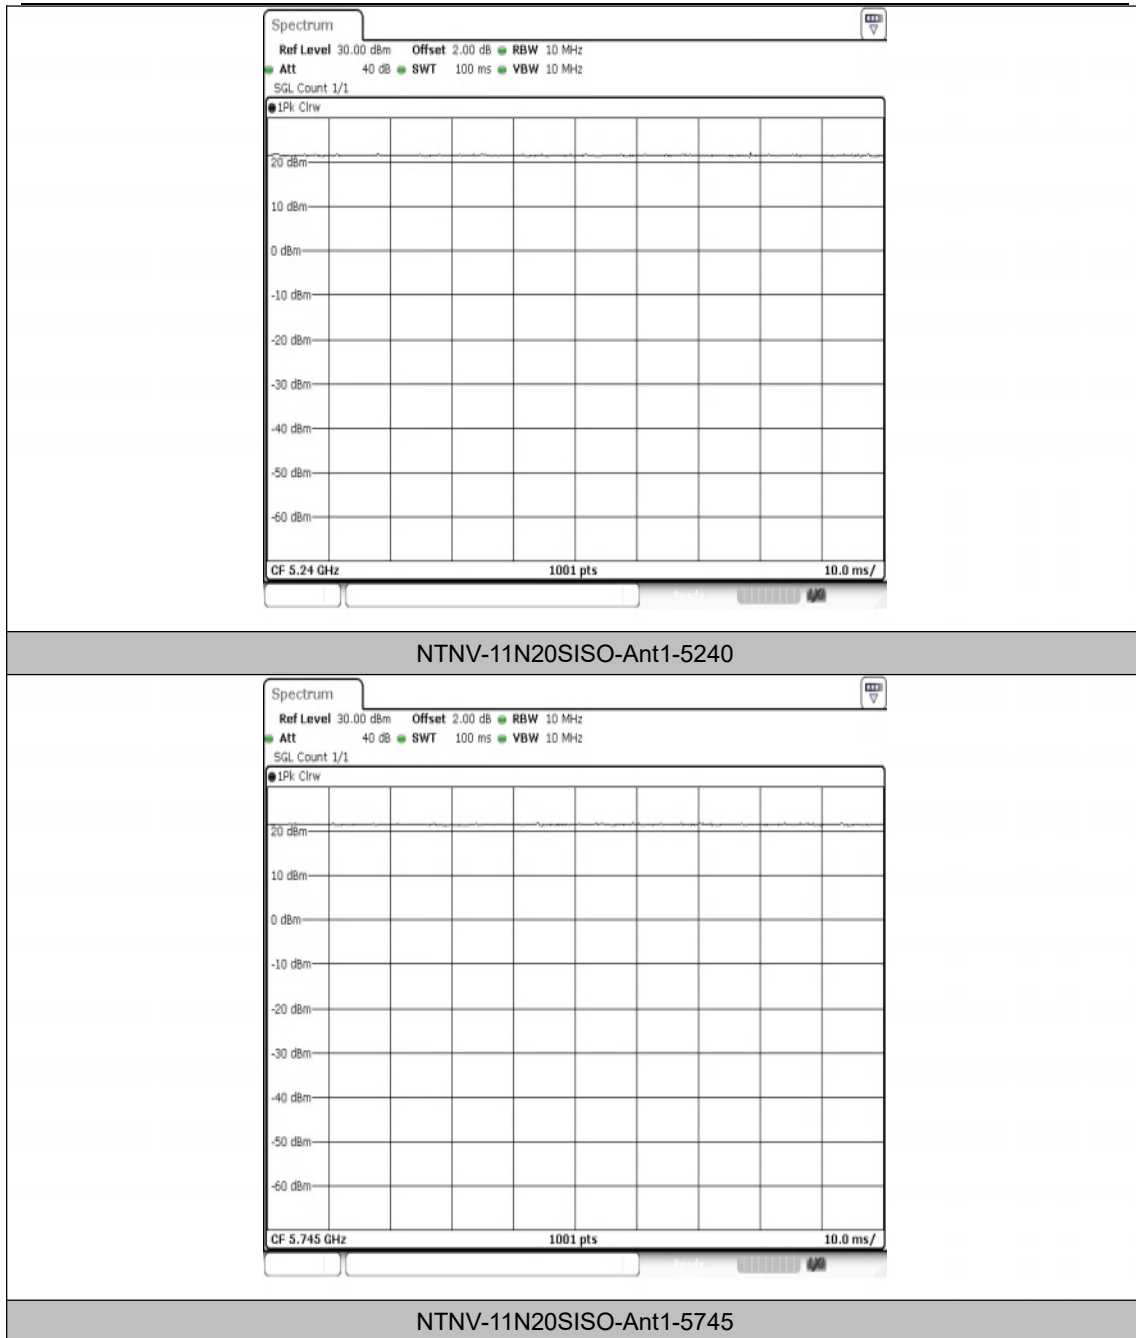

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

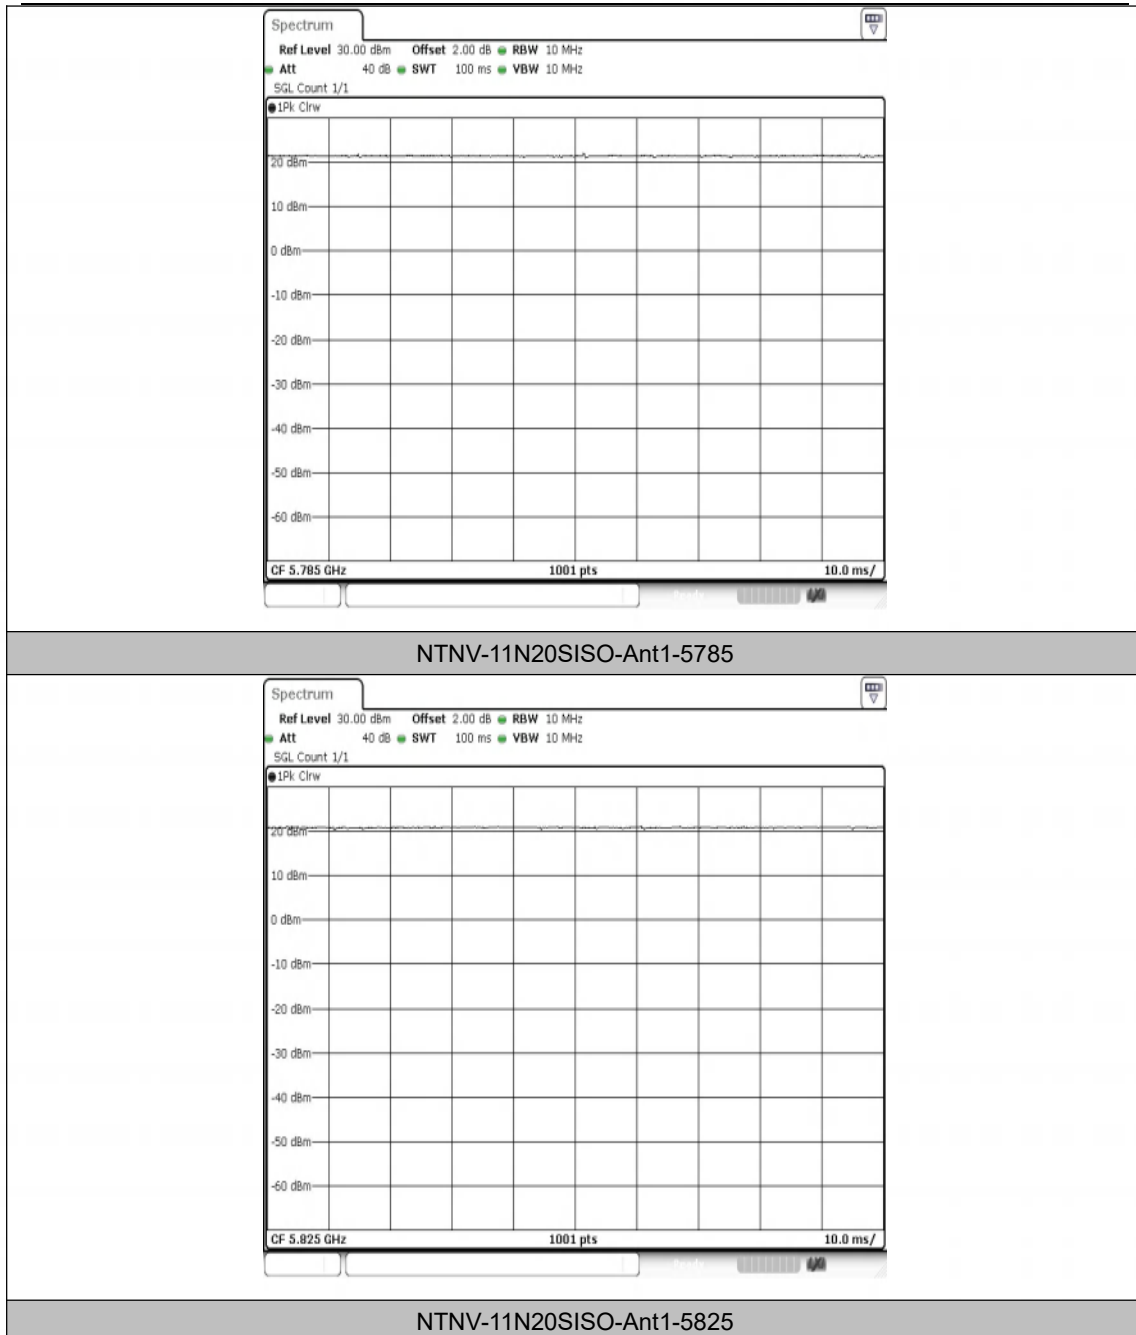

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

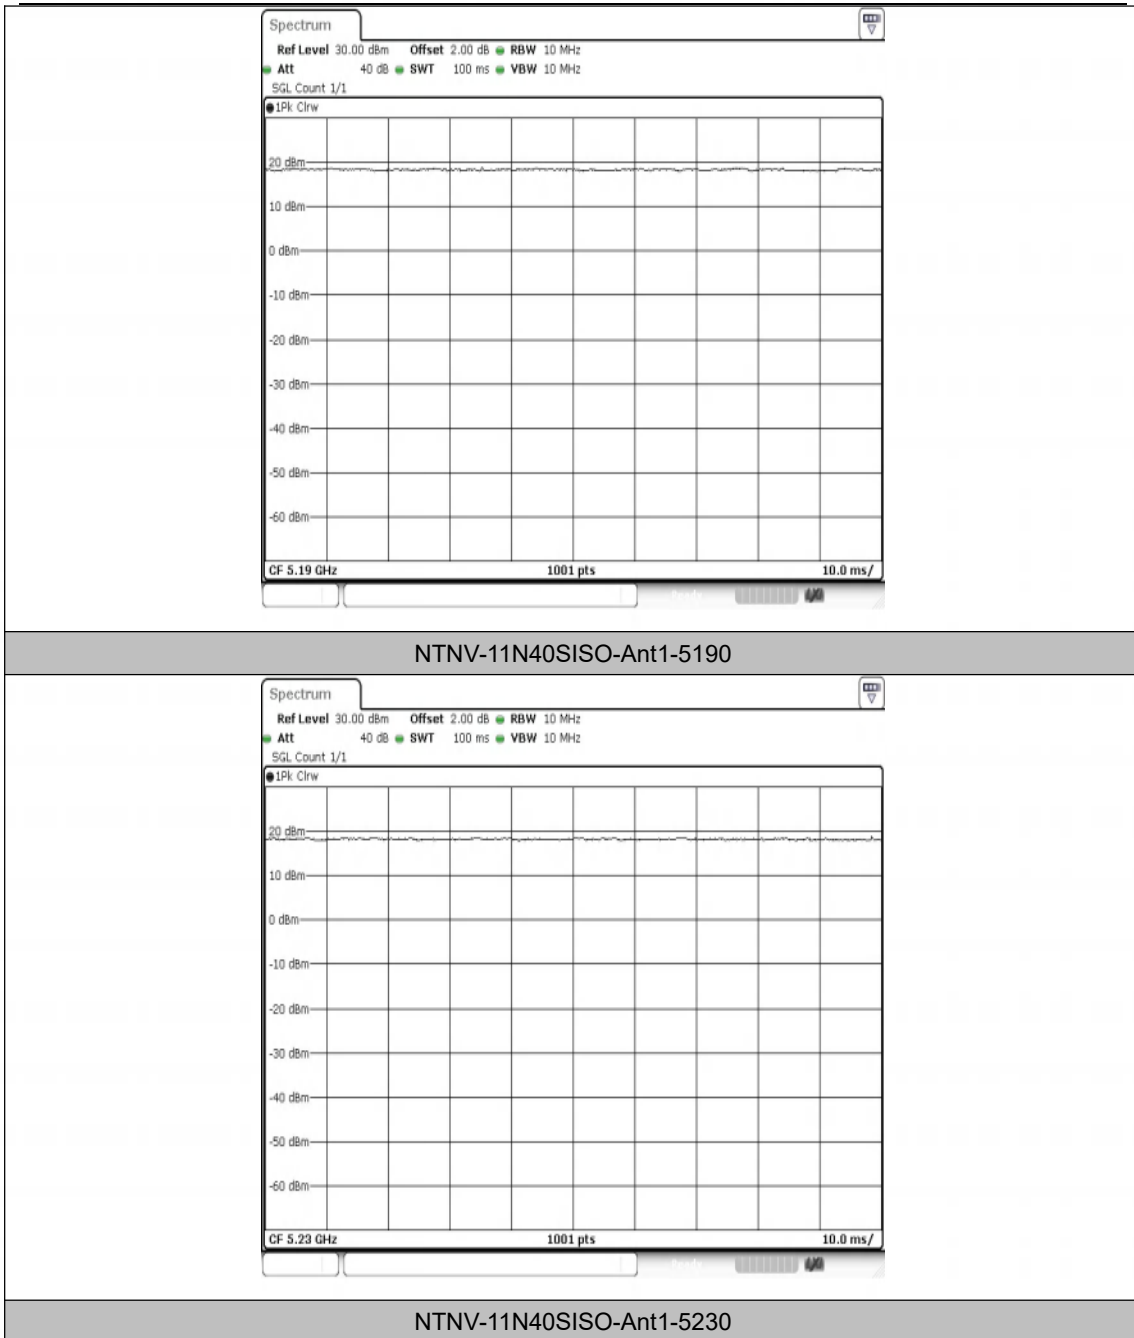

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

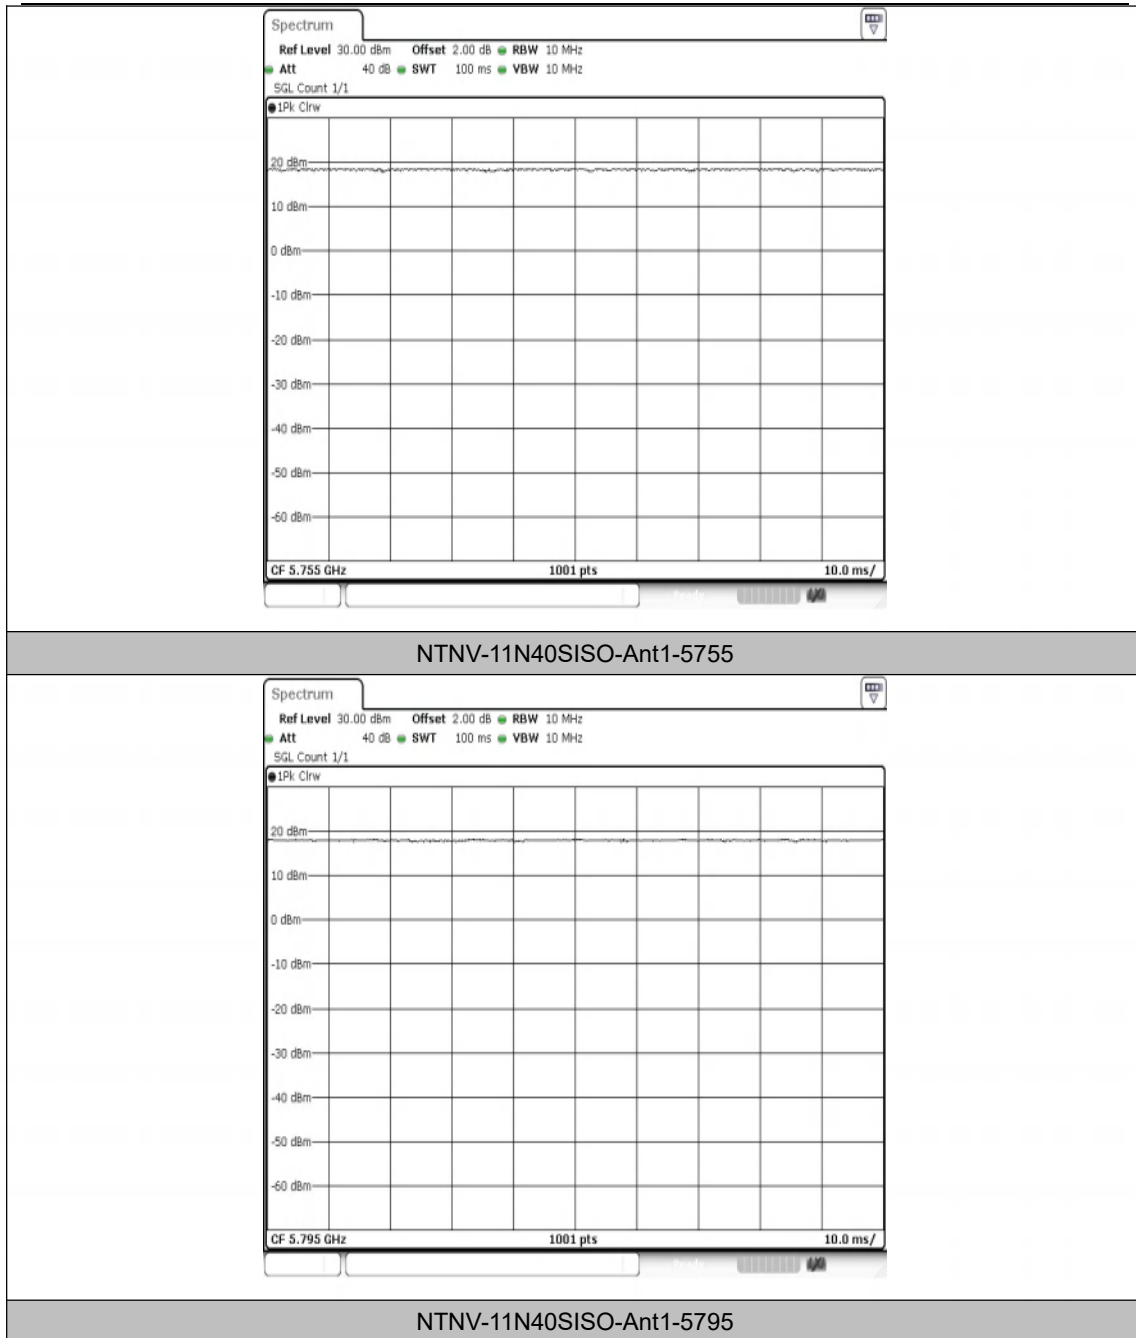

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

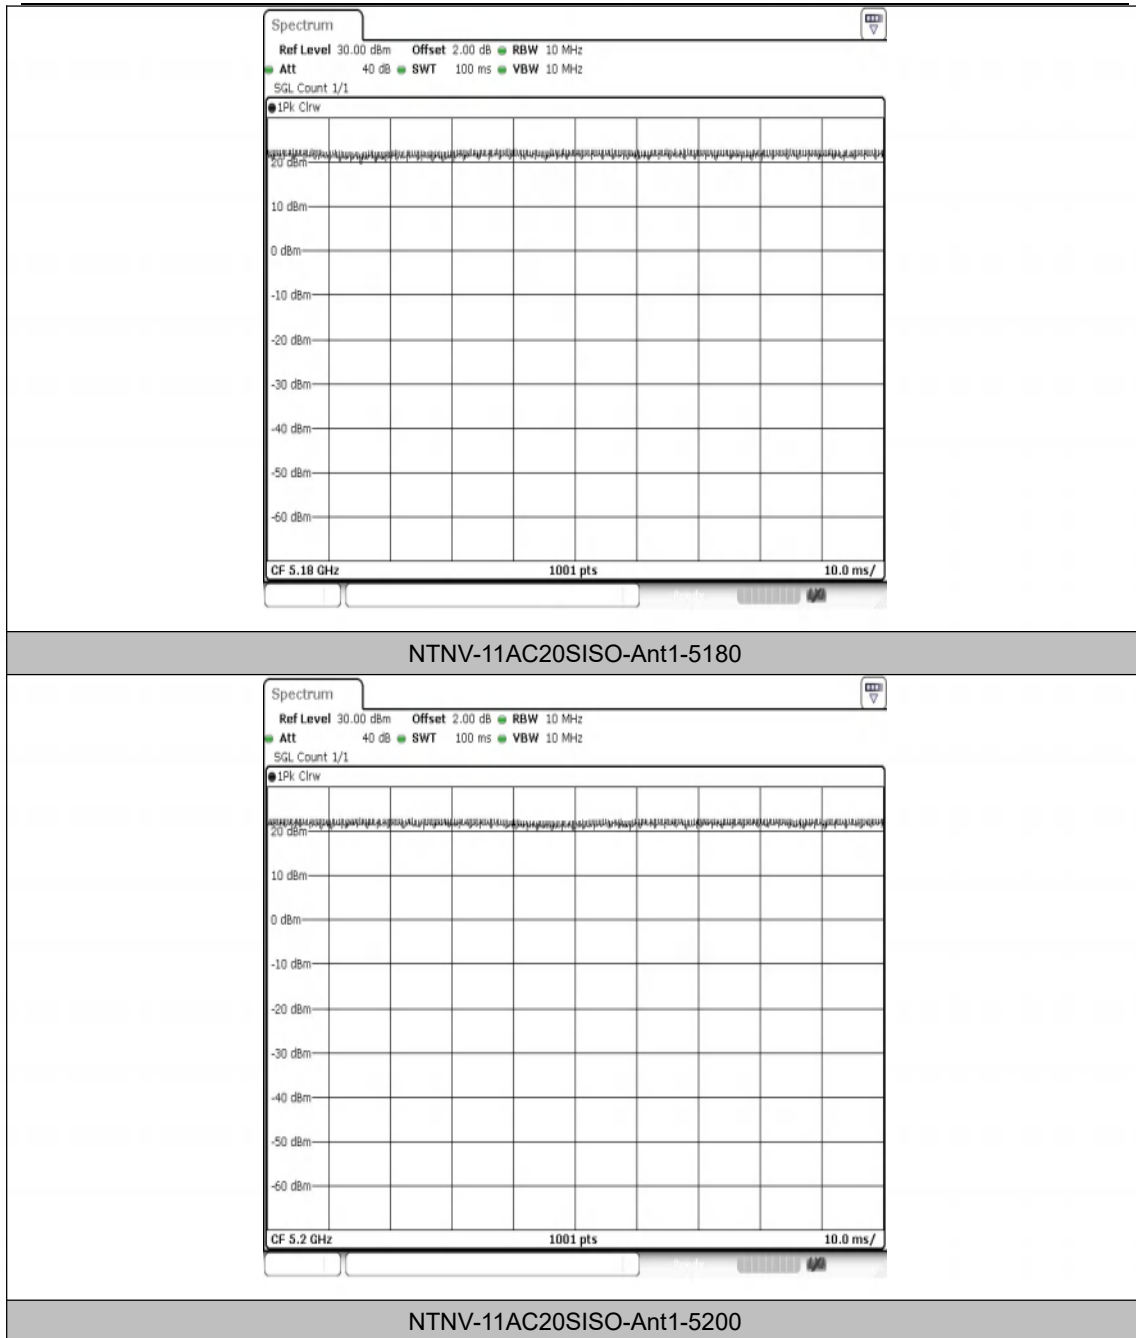

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

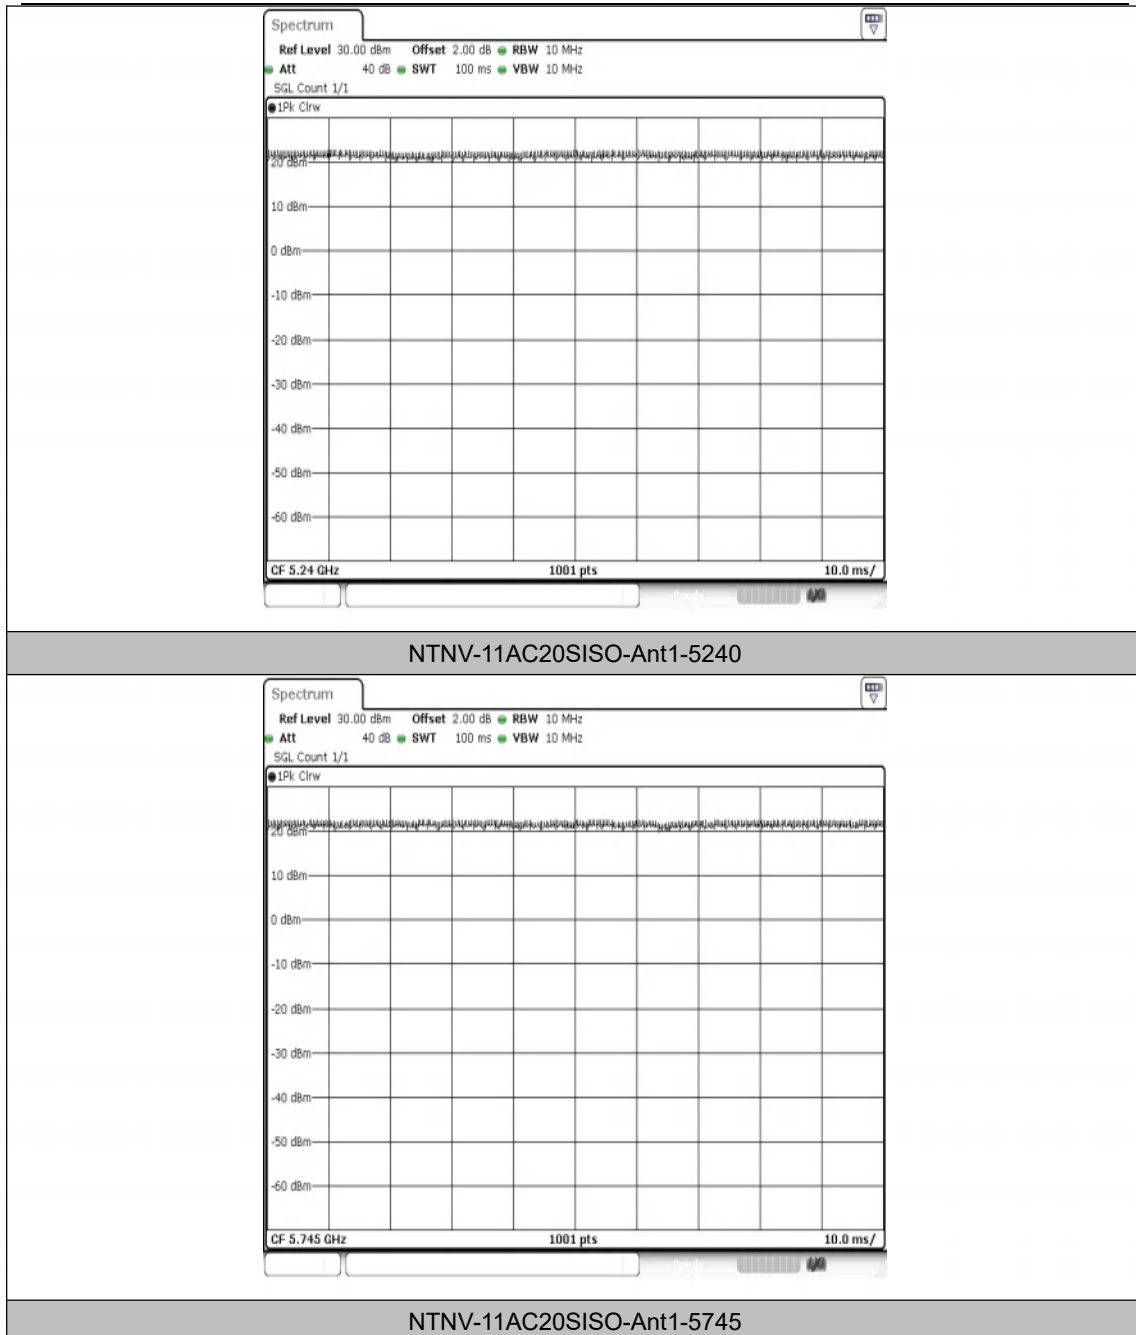

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

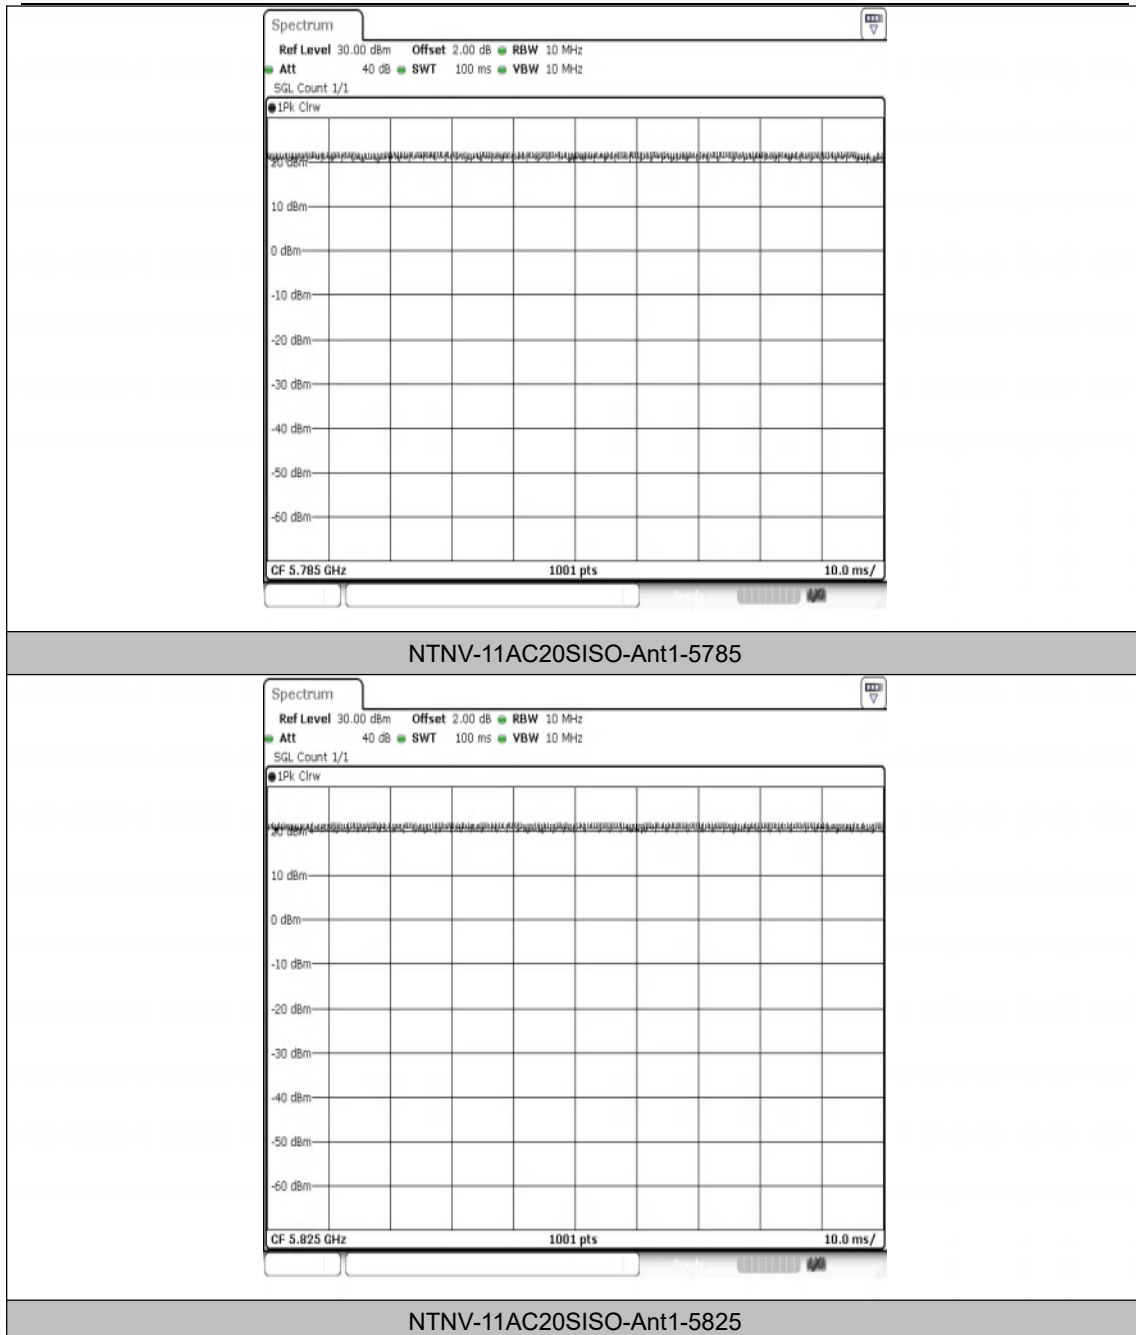

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

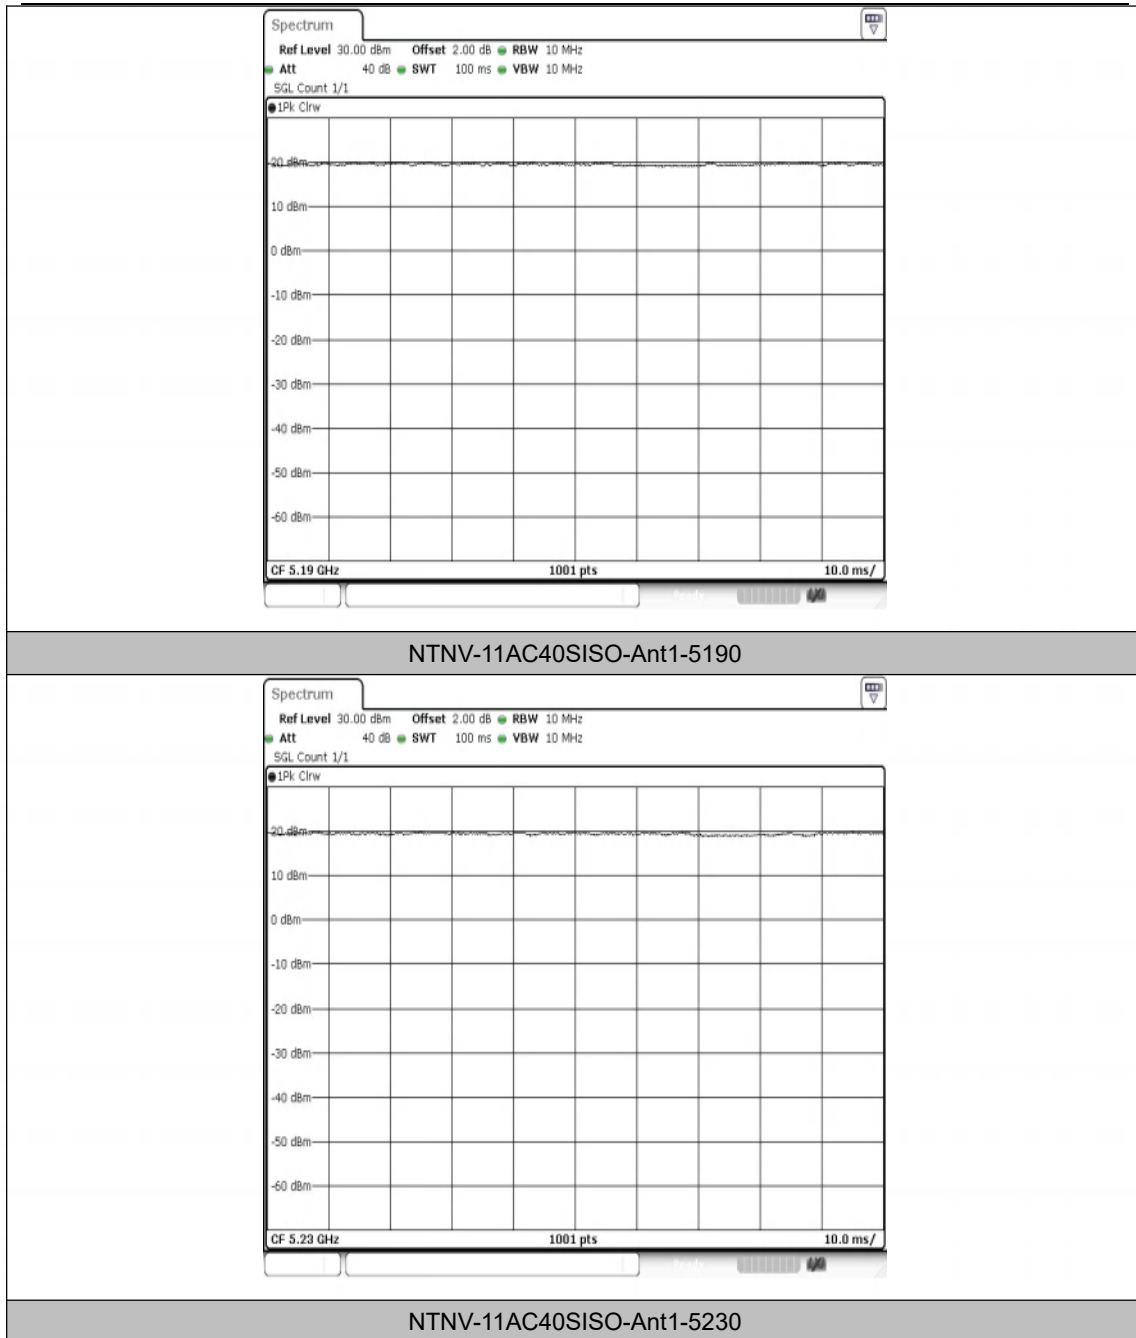

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

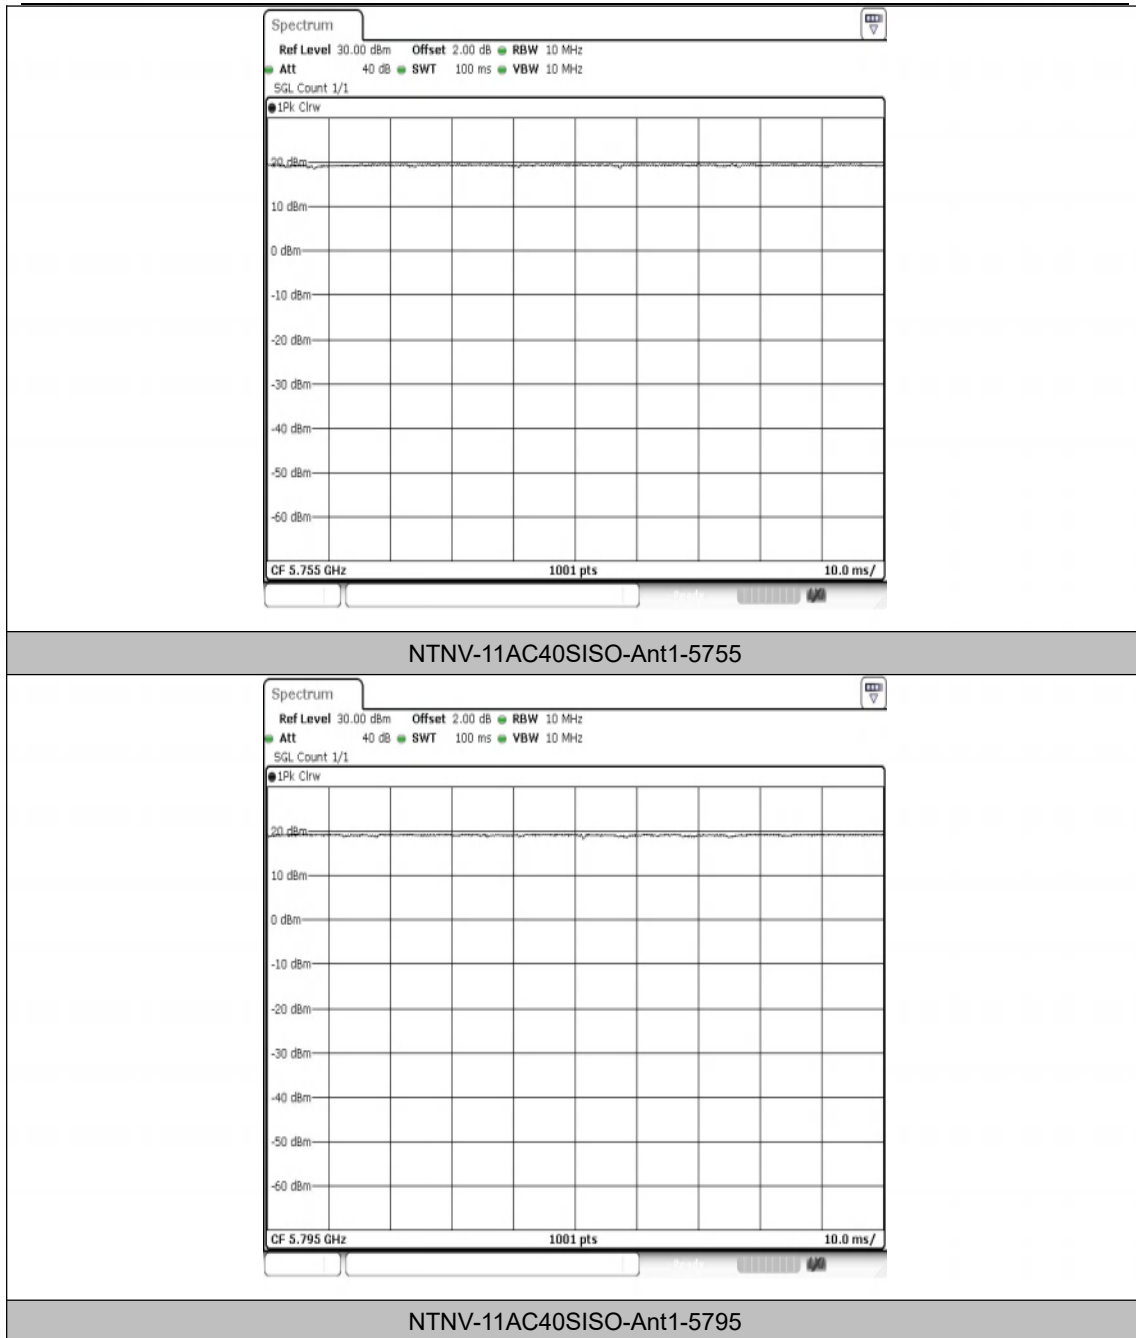

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

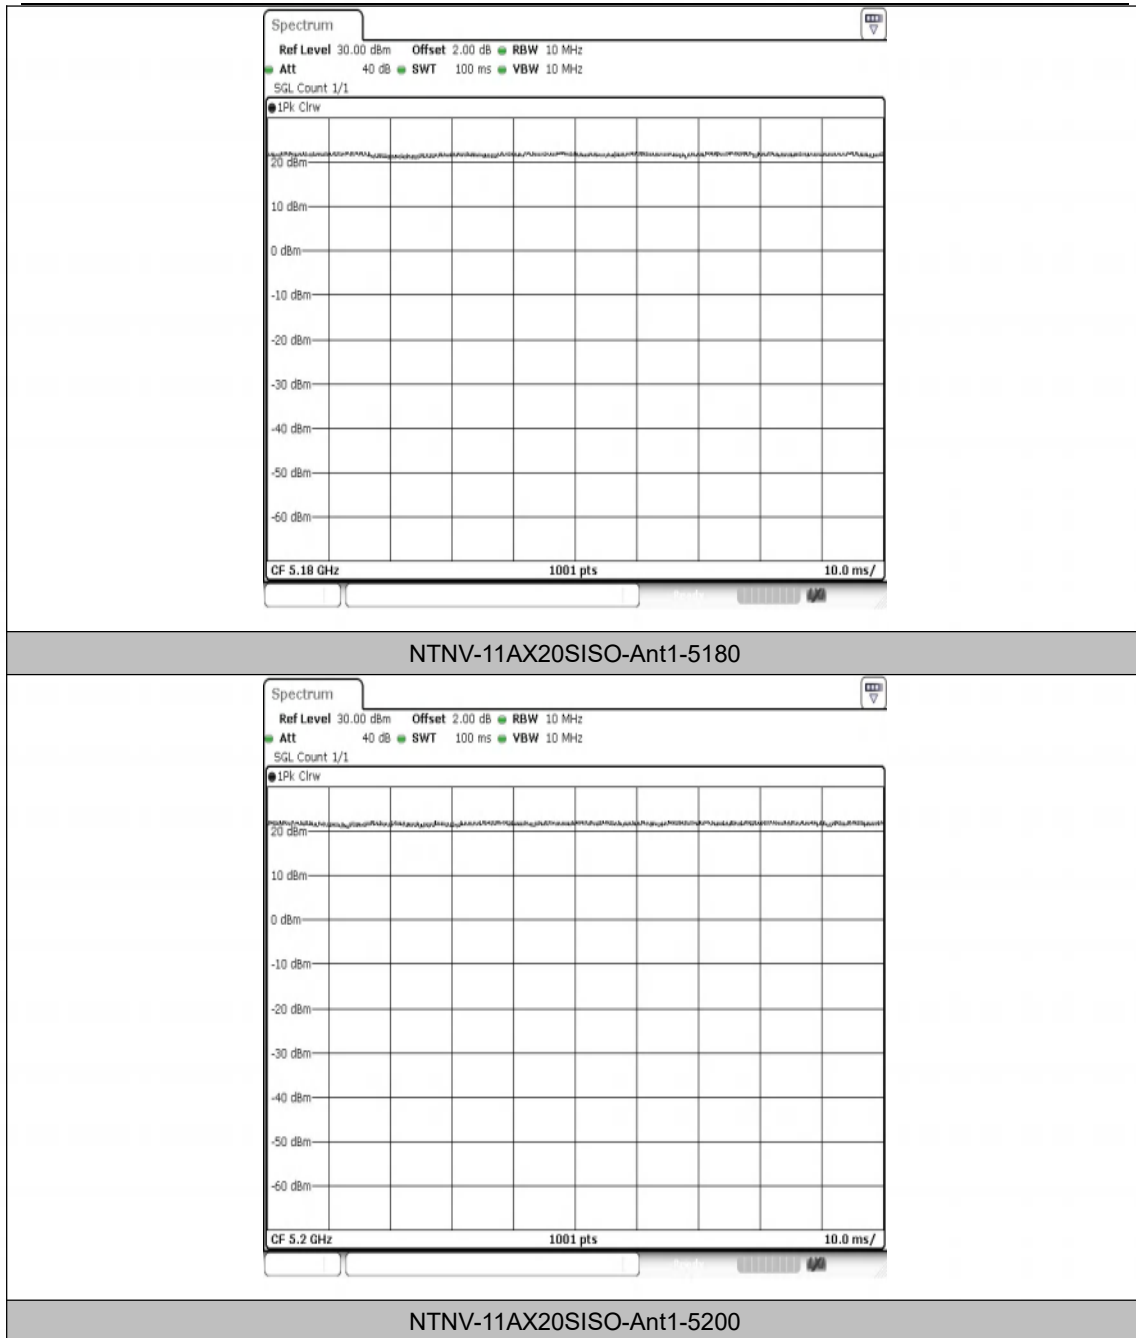

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

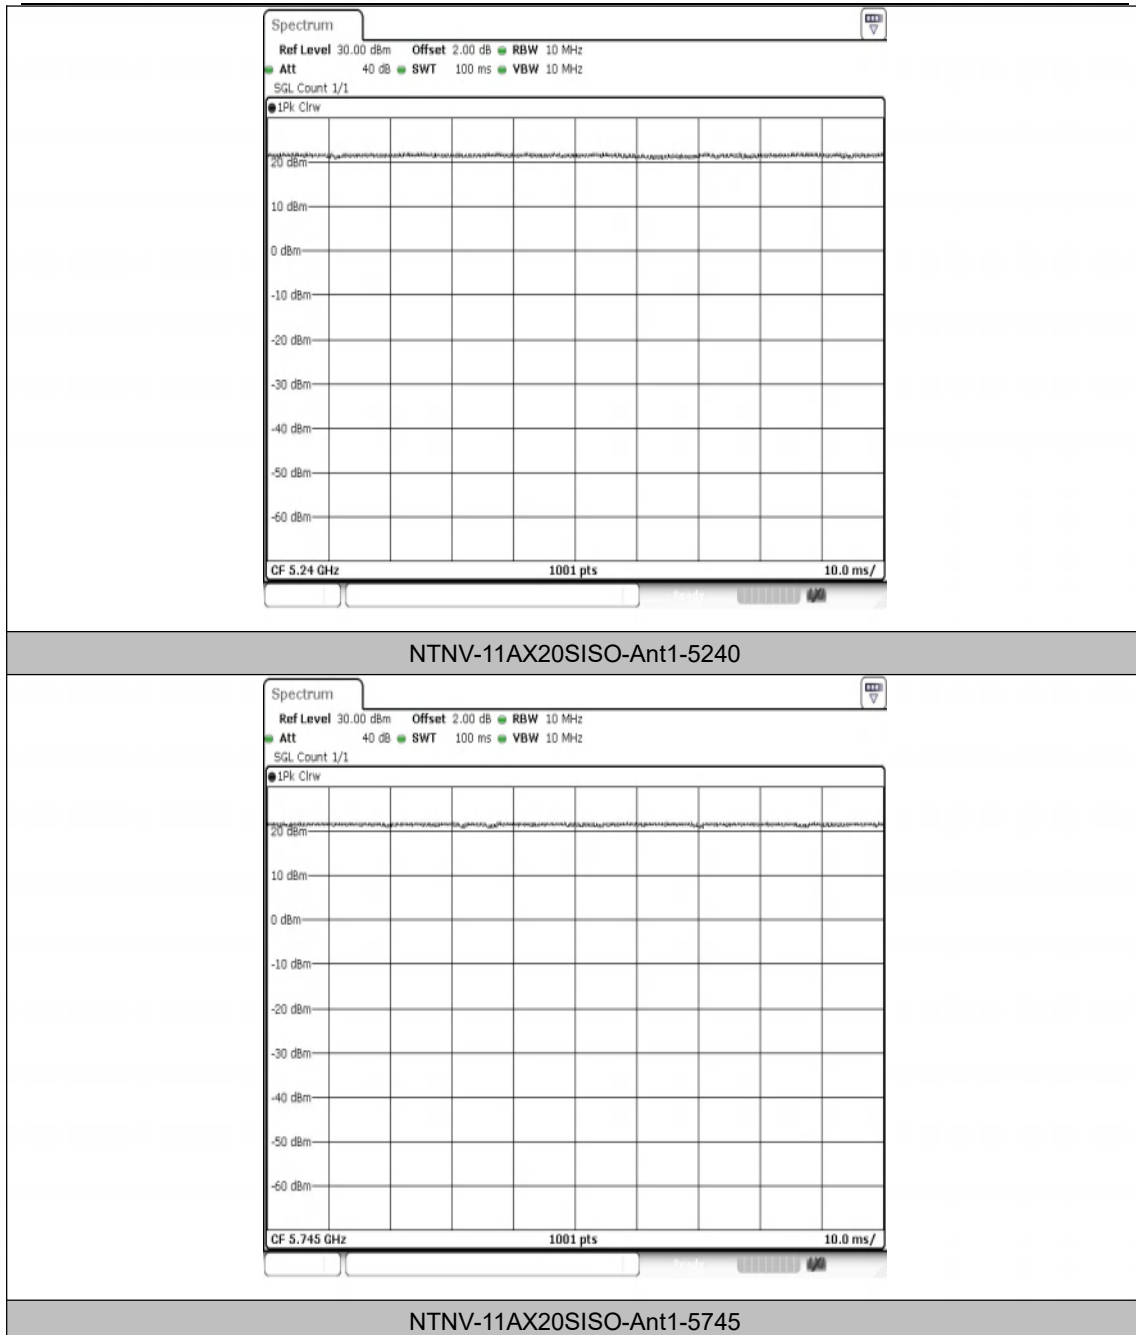

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

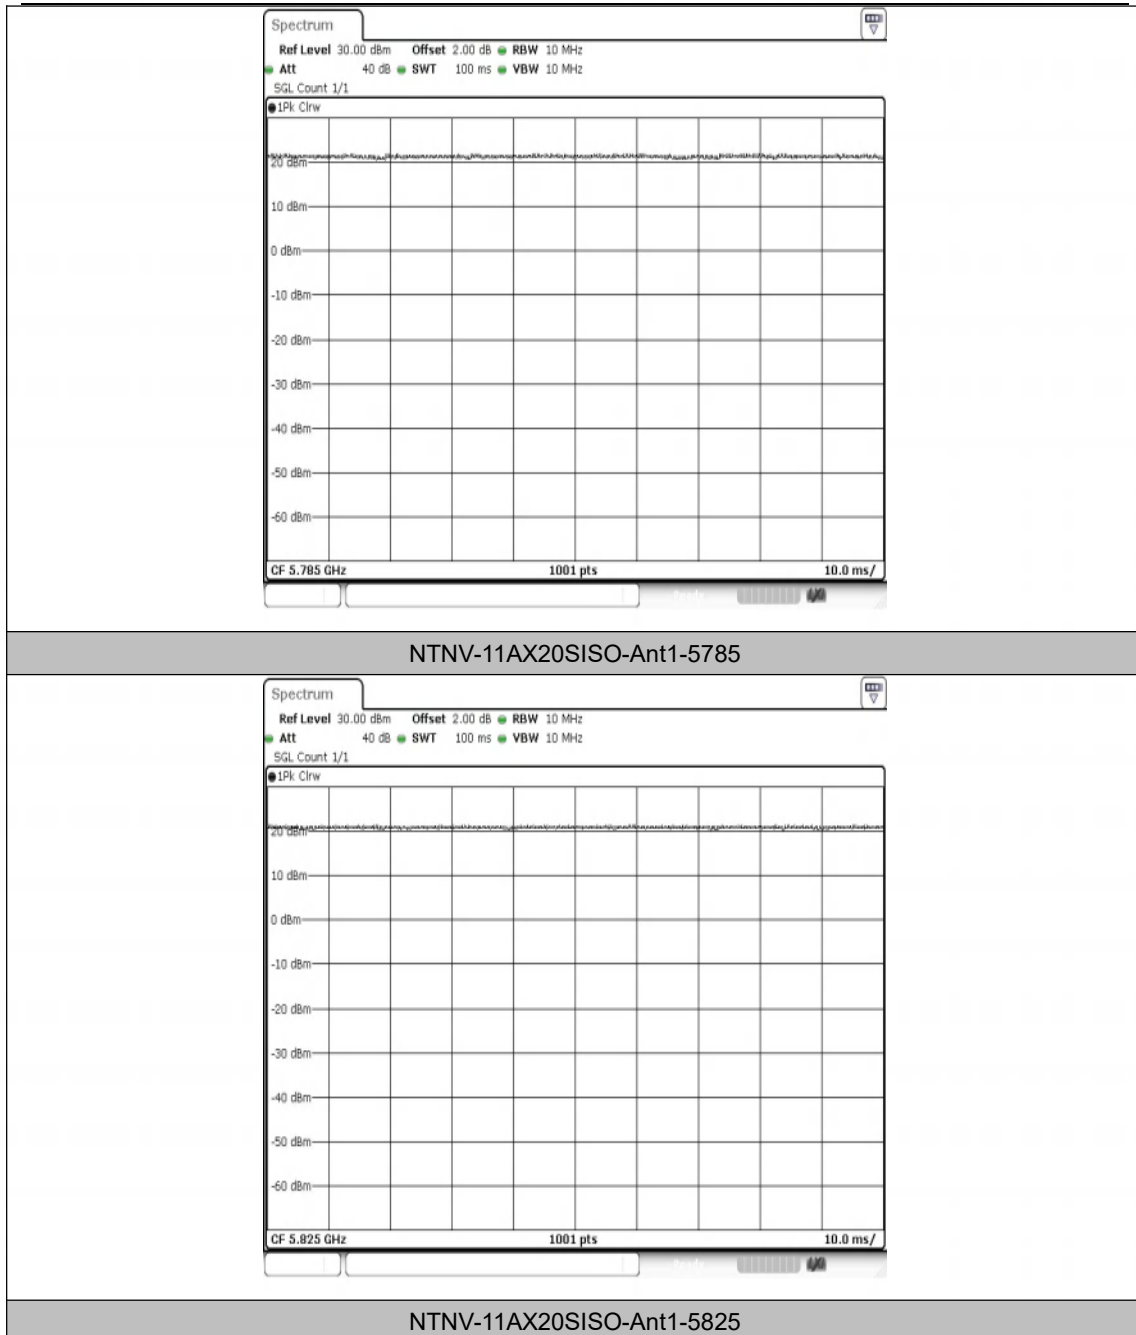

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

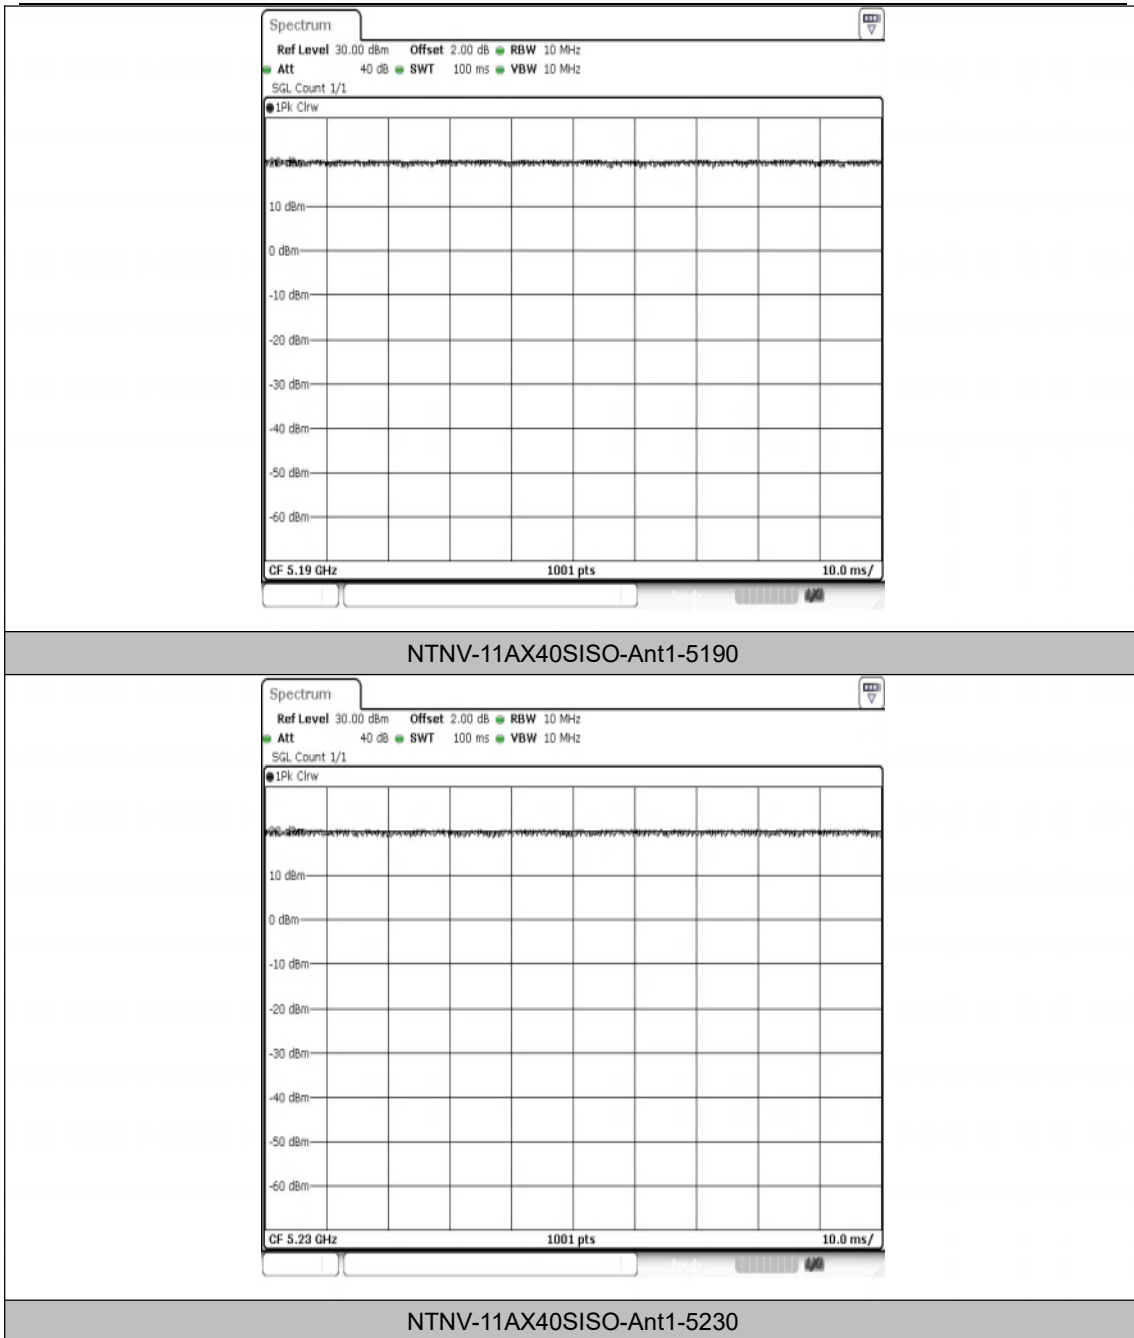

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

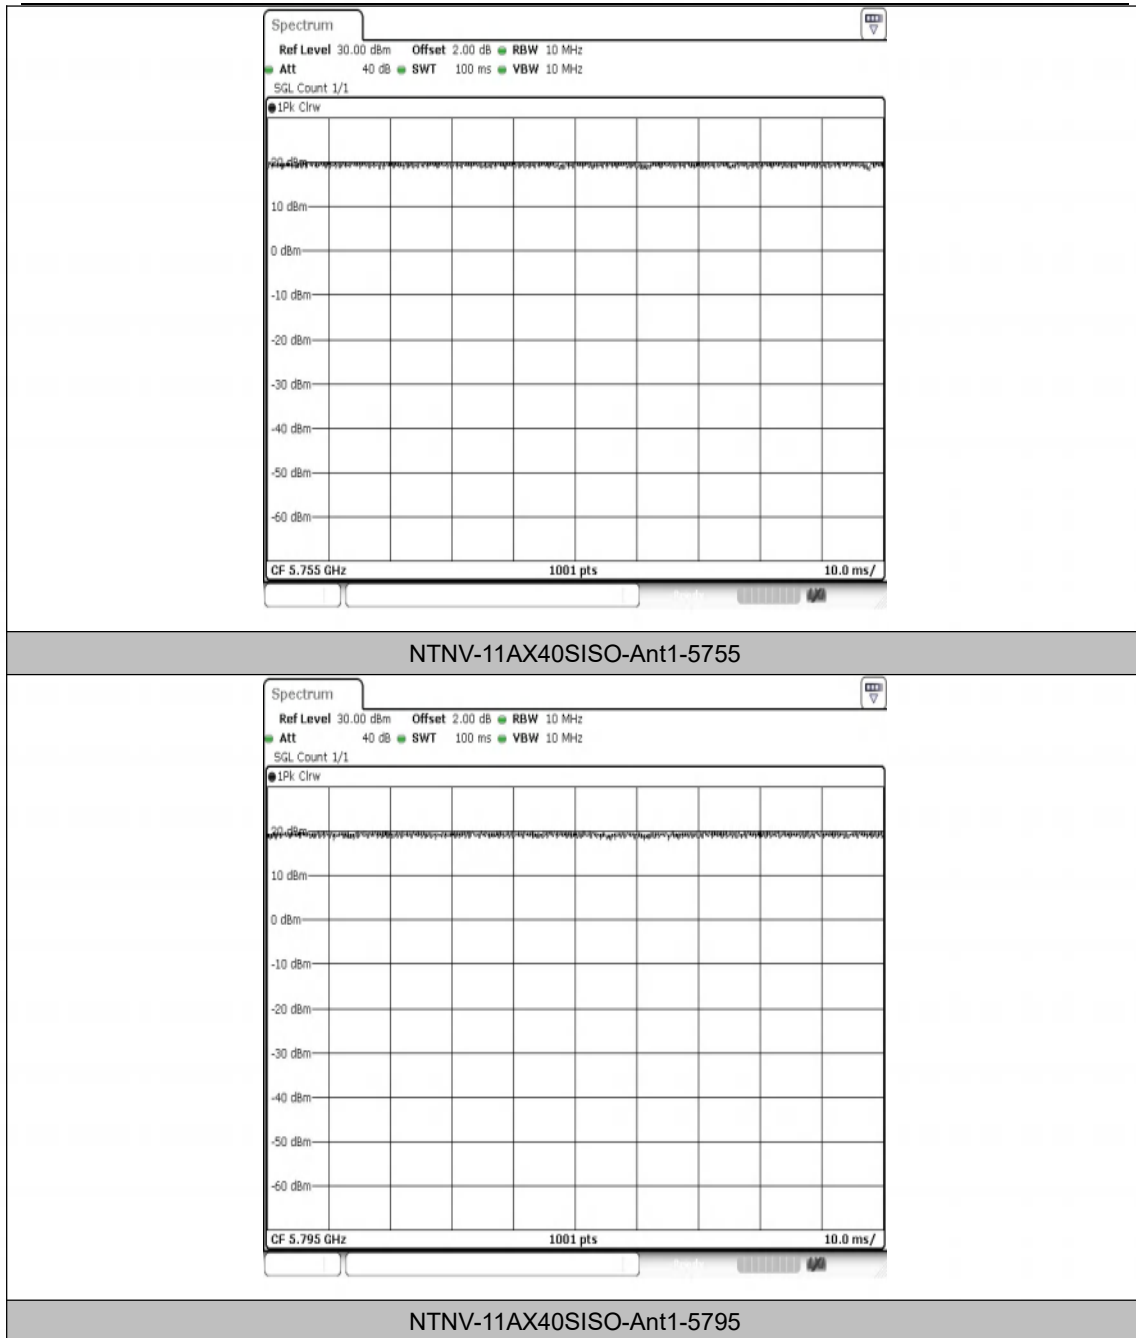

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix C: Maximum Conducted Output Power

Test Result Channel Power

Test Mode	Antenna	Frequency[MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	14.90	≤23.98	PASS
11A	Ant1	5200	15.05	≤23.98	PASS
11A	Ant1	5240	14.75	≤23.98	PASS
11A	Ant1	5745	14.78	≤30.00	PASS
11A	Ant1	5785	14.59	≤30.00	PASS
11A	Ant1	5825	14.12	≤30.00	PASS
11N20SISO	Ant1	5180	14.42	≤23.98	PASS
11N20SISO	Ant1	5200	14.51	≤23.98	PASS
11N20SISO	Ant1	5240	14.28	≤23.98	PASS
11N20SISO	Ant1	5745	14.36	≤30.00	PASS
11N20SISO	Ant1	5785	14.25	≤30.00	PASS
11N20SISO	Ant1	5825	13.69	≤30.00	PASS
11N40SISO	Ant1	5190	14.03	≤23.98	PASS
11N40SISO	Ant1	5230	13.89	≤23.98	PASS
11N40SISO	Ant1	5755	13.97	≤30.00	PASS
11N40SISO	Ant1	5795	13.71	≤30.00	PASS
11AC20SISO	Ant1	5180	14.69	≤23.98	PASS
11AC20SISO	Ant1	5200	14.81	≤23.98	PASS
11AC20SISO	Ant1	5240	14.56	≤23.98	PASS
11AC20SISO	Ant1	5745	14.56	≤30.00	PASS
11AC20SISO	Ant1	5785	14.40	≤30.00	PASS
11AC20SISO	Ant1	5825	13.95	≤30.00	PASS
11AC40SISO	Ant1	5190	14.76	≤23.98	PASS
11AC40SISO	Ant1	5230	14.60	≤23.98	PASS
11AC40SISO	Ant1	5755	14.55	≤30.00	PASS
11AC40SISO	Ant1	5795	14.34	≤30.00	PASS
11AX20SISO	Ant1	5180	14.64	≤23.98	PASS
11AX20SISO	Ant1	5200	14.74	≤23.98	PASS
11AX20SISO	Ant1	5240	14.51	≤23.98	PASS
11AX20SISO	Ant1	5745	14.54	≤30.00	PASS
11AX20SISO	Ant1	5785	14.38	≤30.00	PASS
11AX20SISO	Ant1	5825	13.93	≤30.00	PASS
11AX40SISO	Ant1	5190	14.94	≤23.98	PASS
11AX40SISO	Ant1	5230	14.76	≤23.98	PASS
11AX40SISO	Ant1	5755	14.64	≤30.00	PASS
11AX40SISO	Ant1	5795	14.36	≤30.00	PASS


Note: 1.The cable loss are compensated in the graph.


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs Channel Power

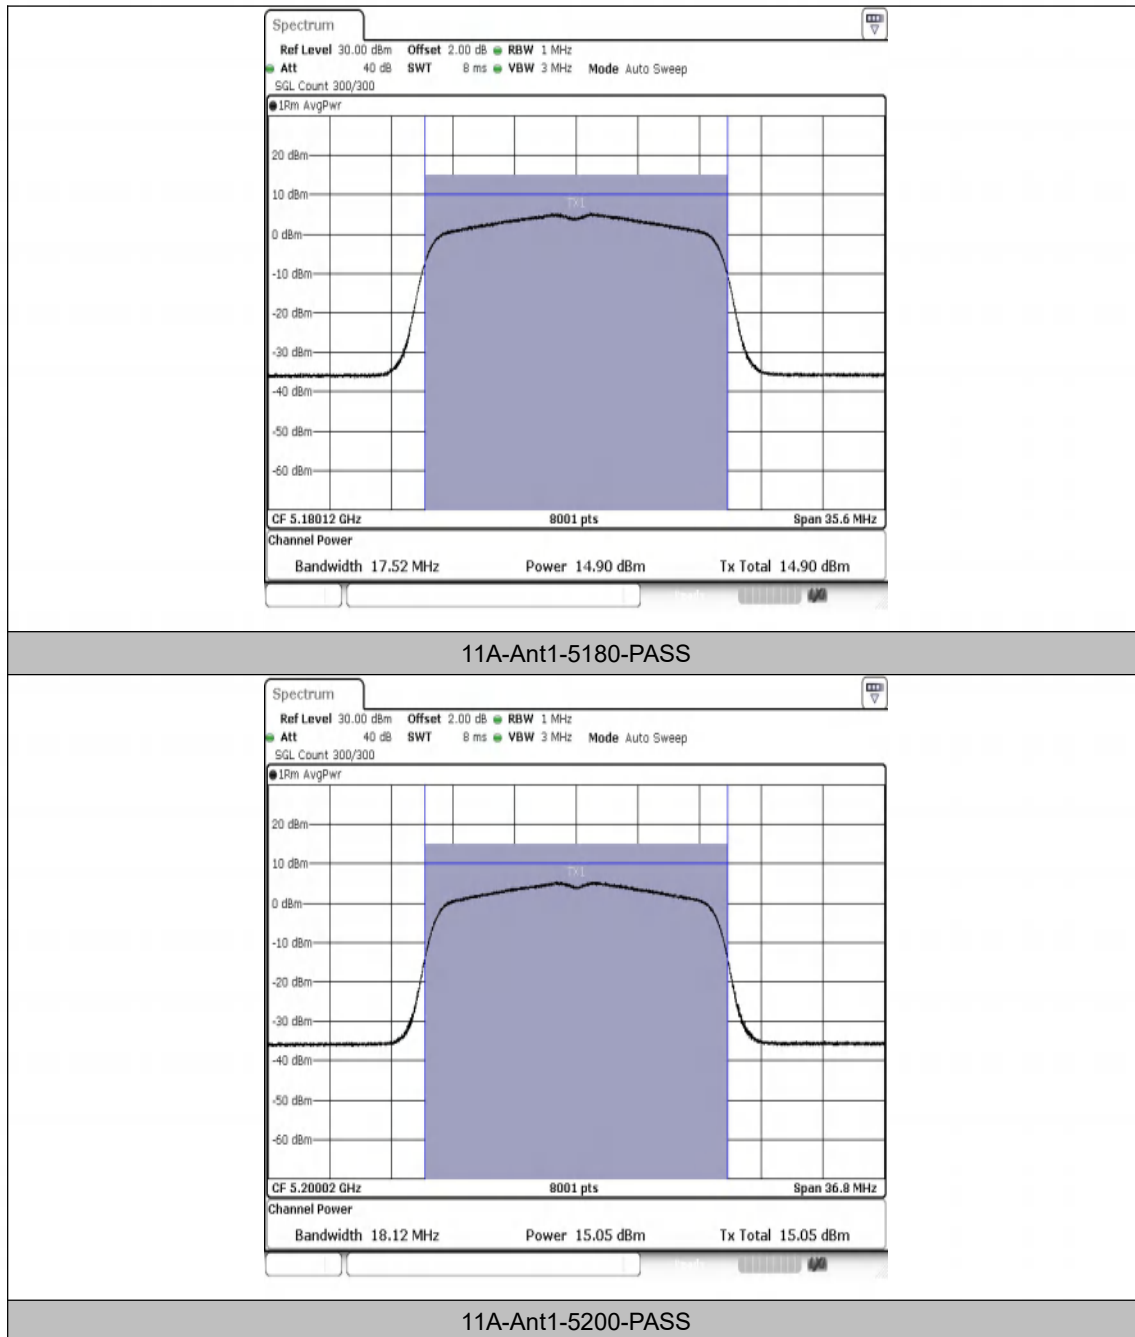


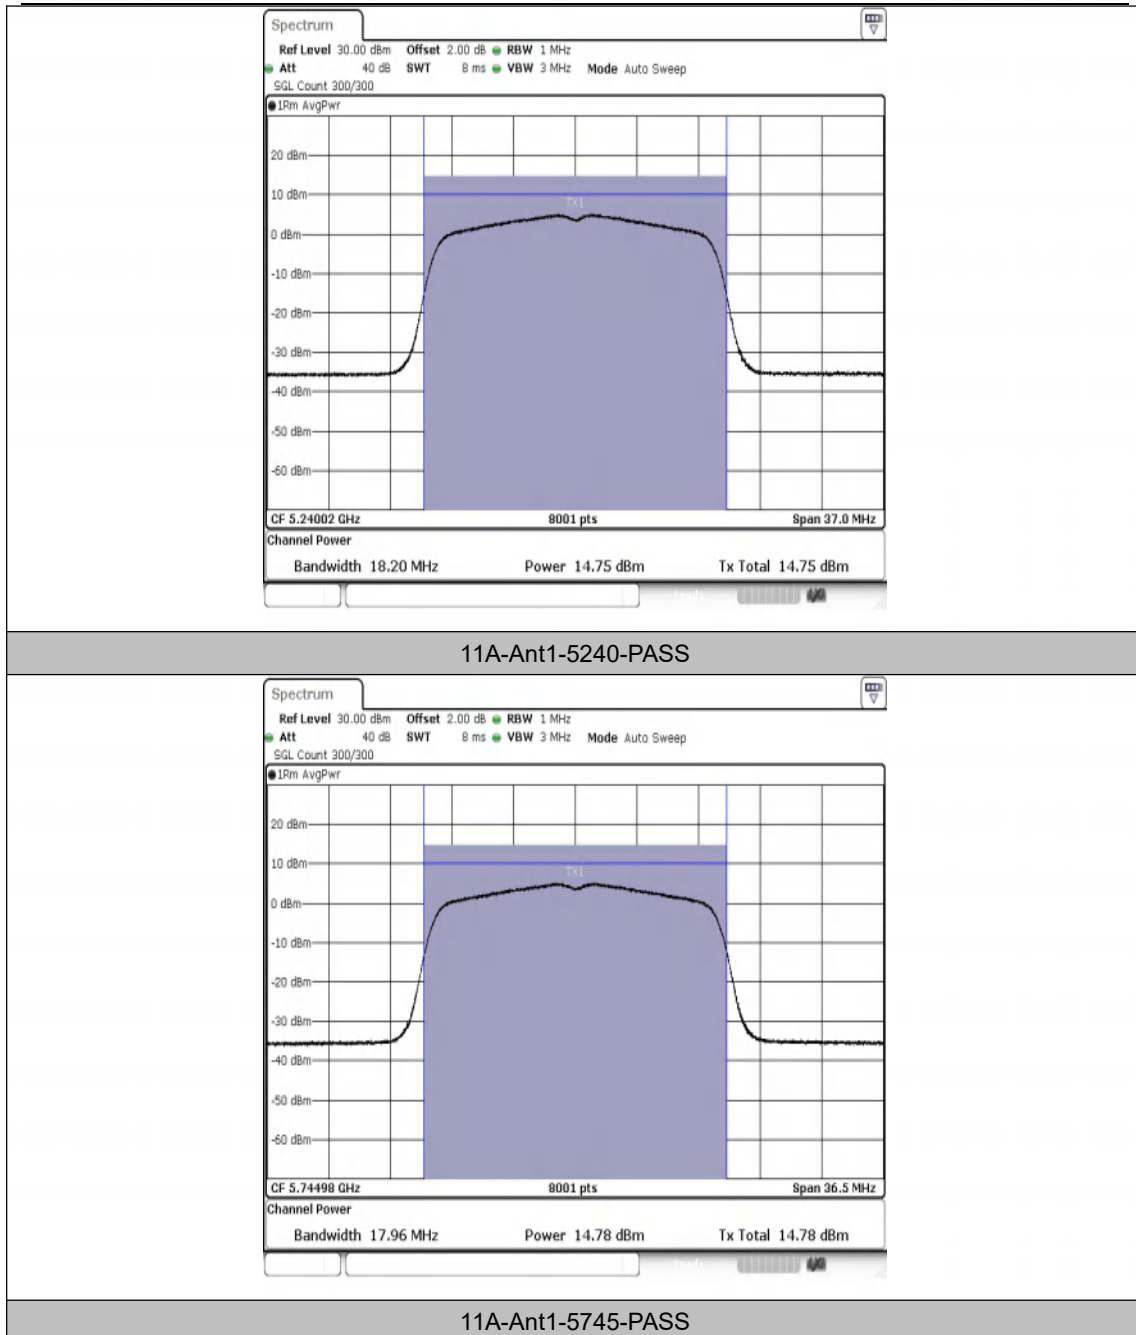


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

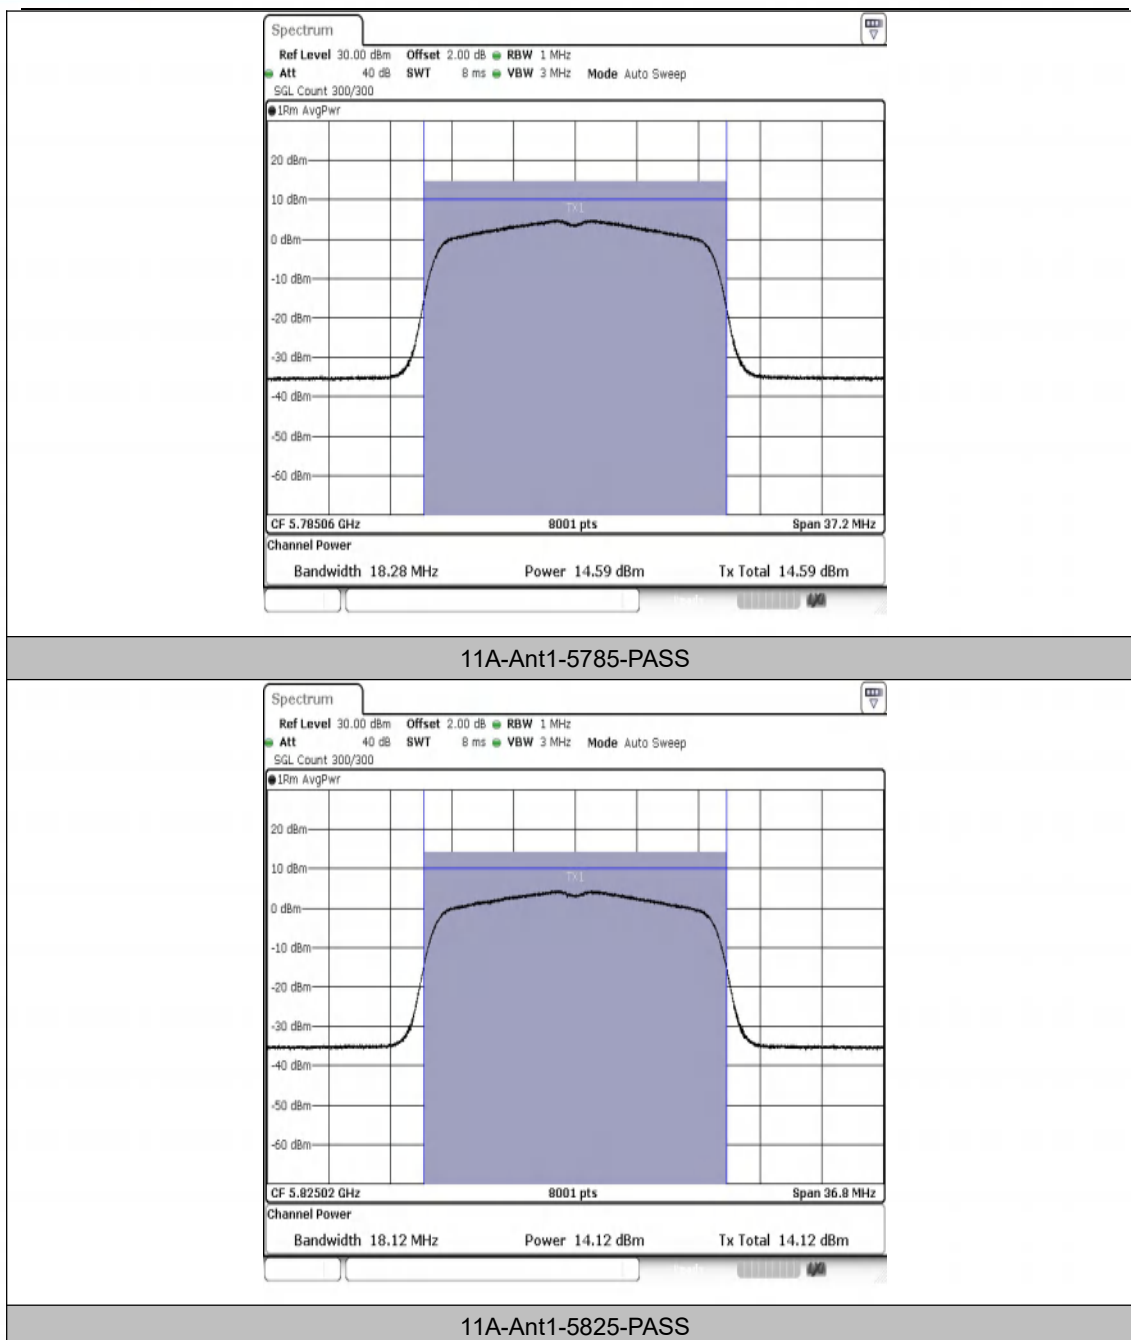


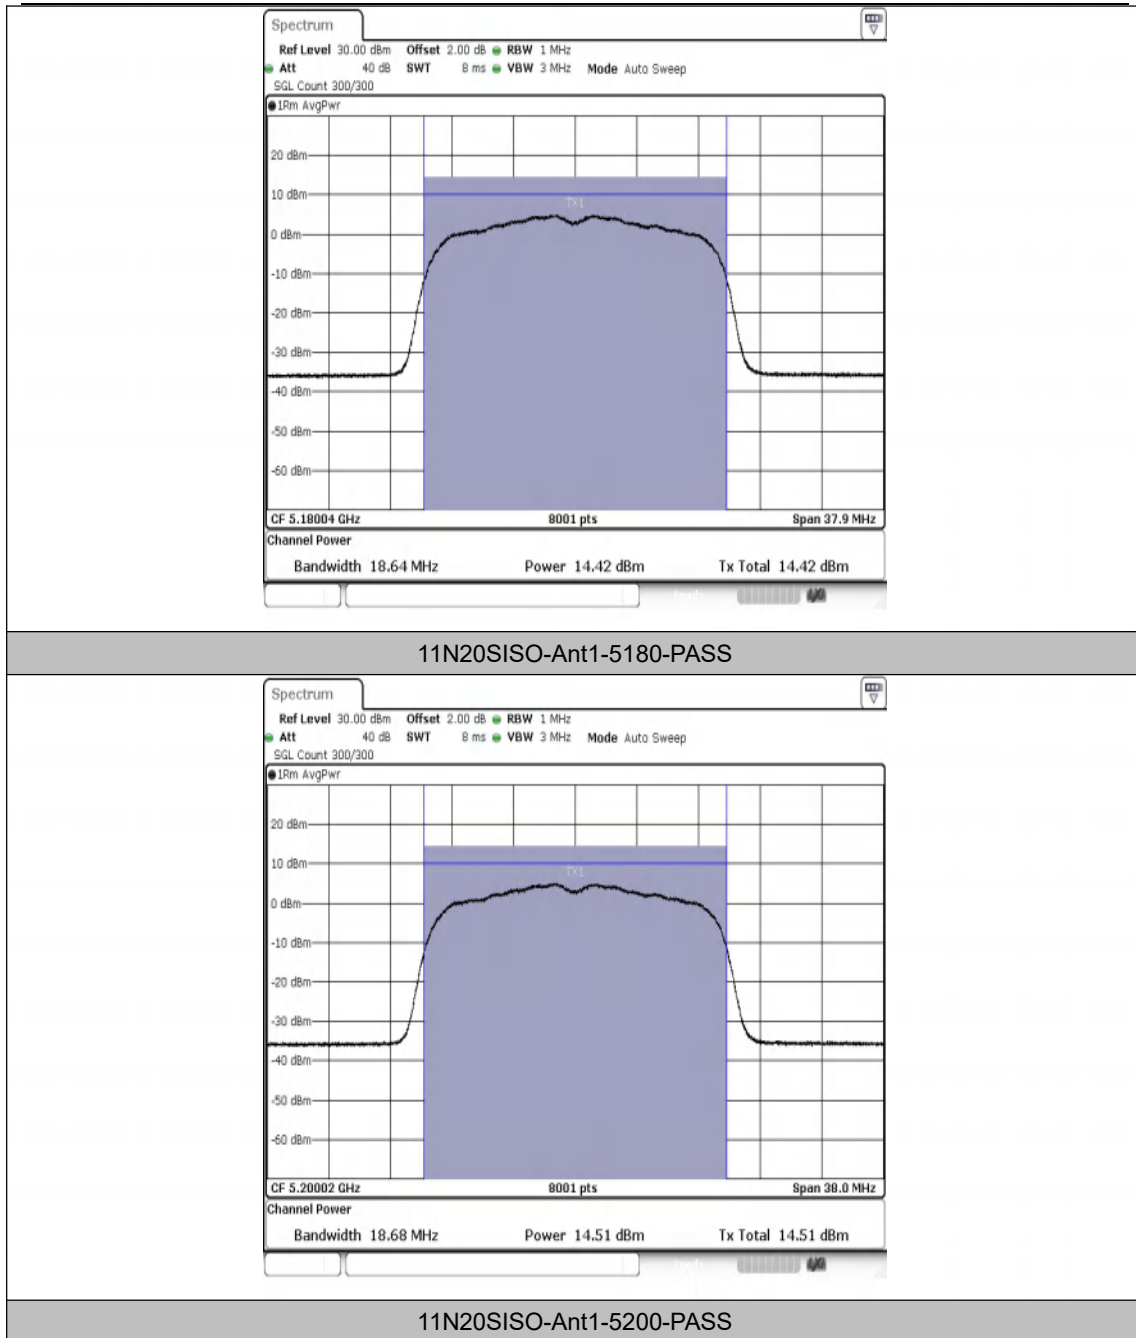



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

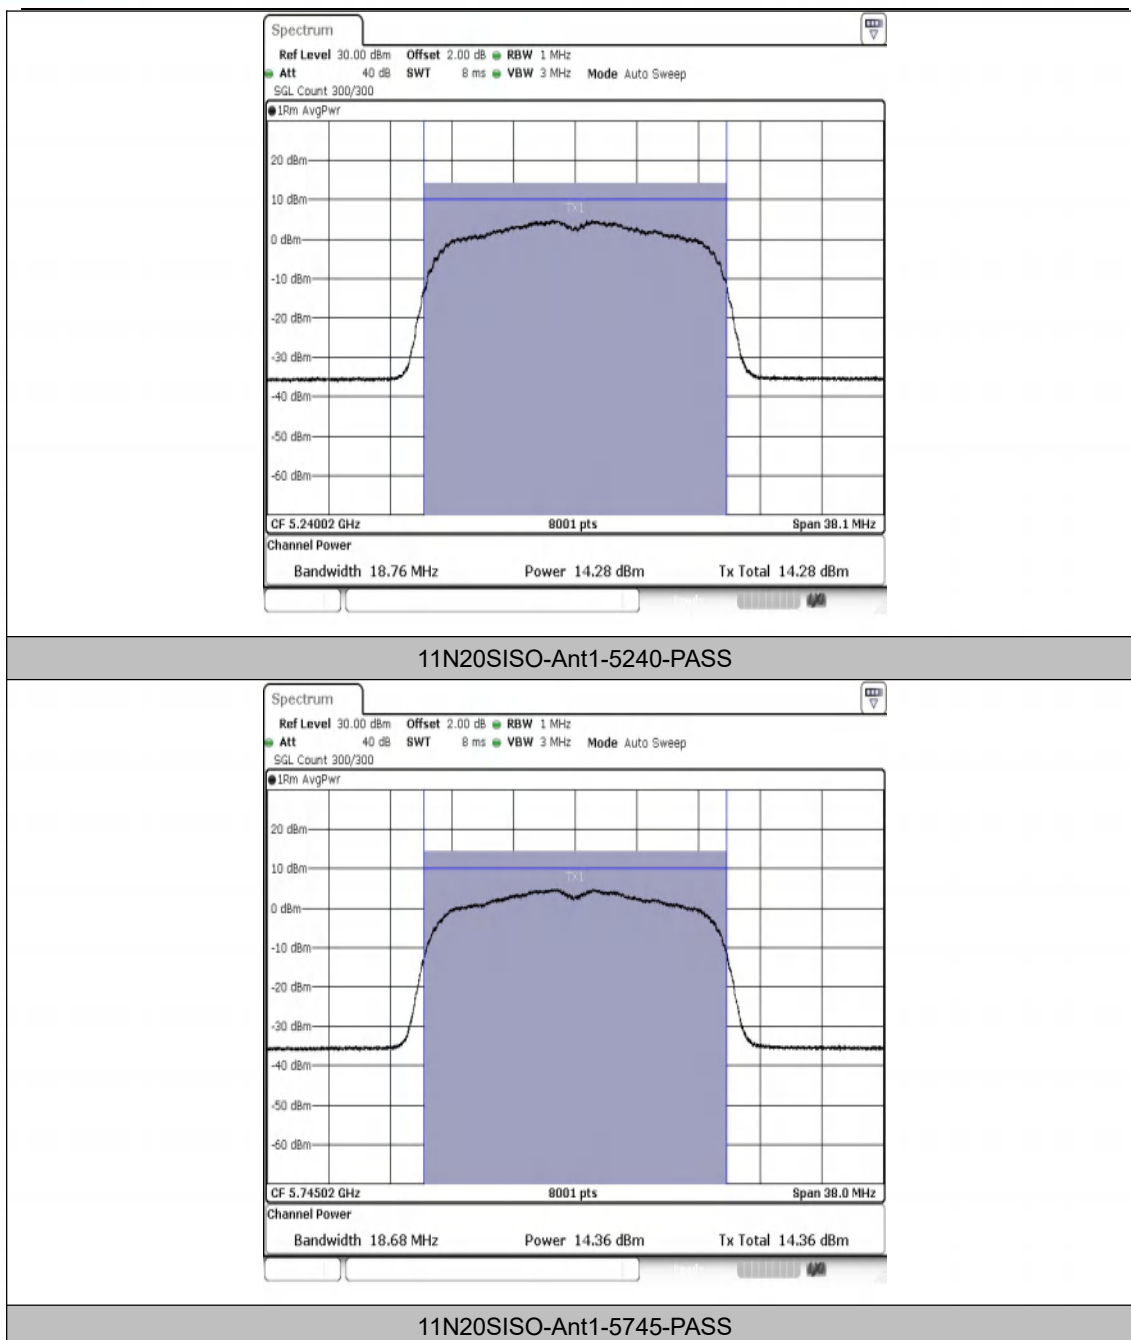

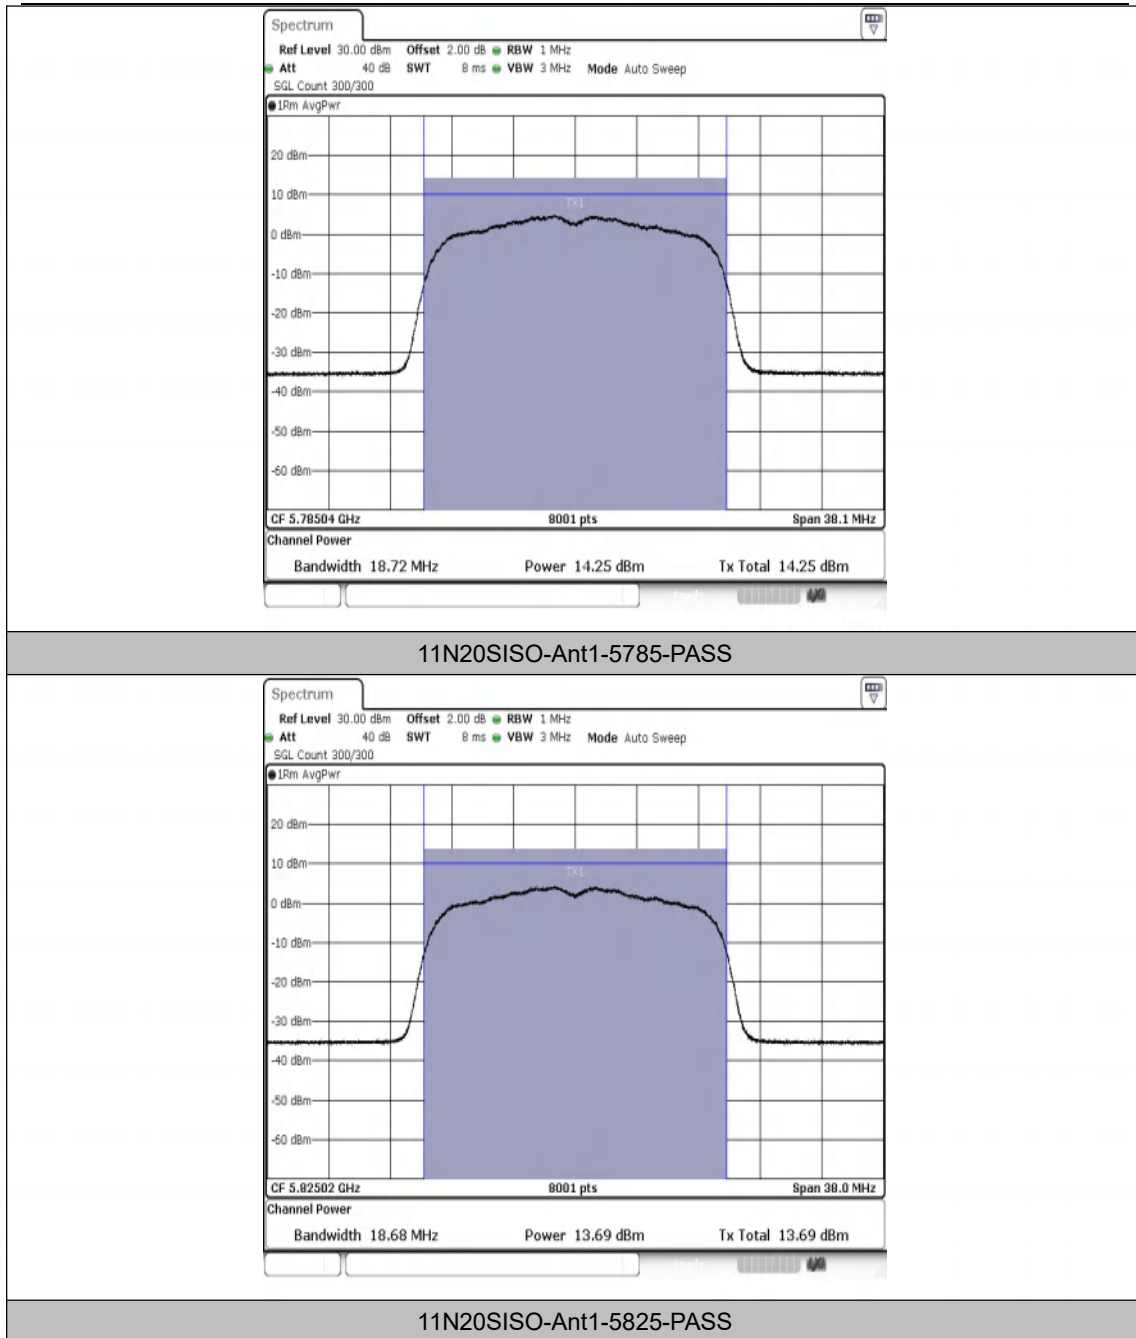


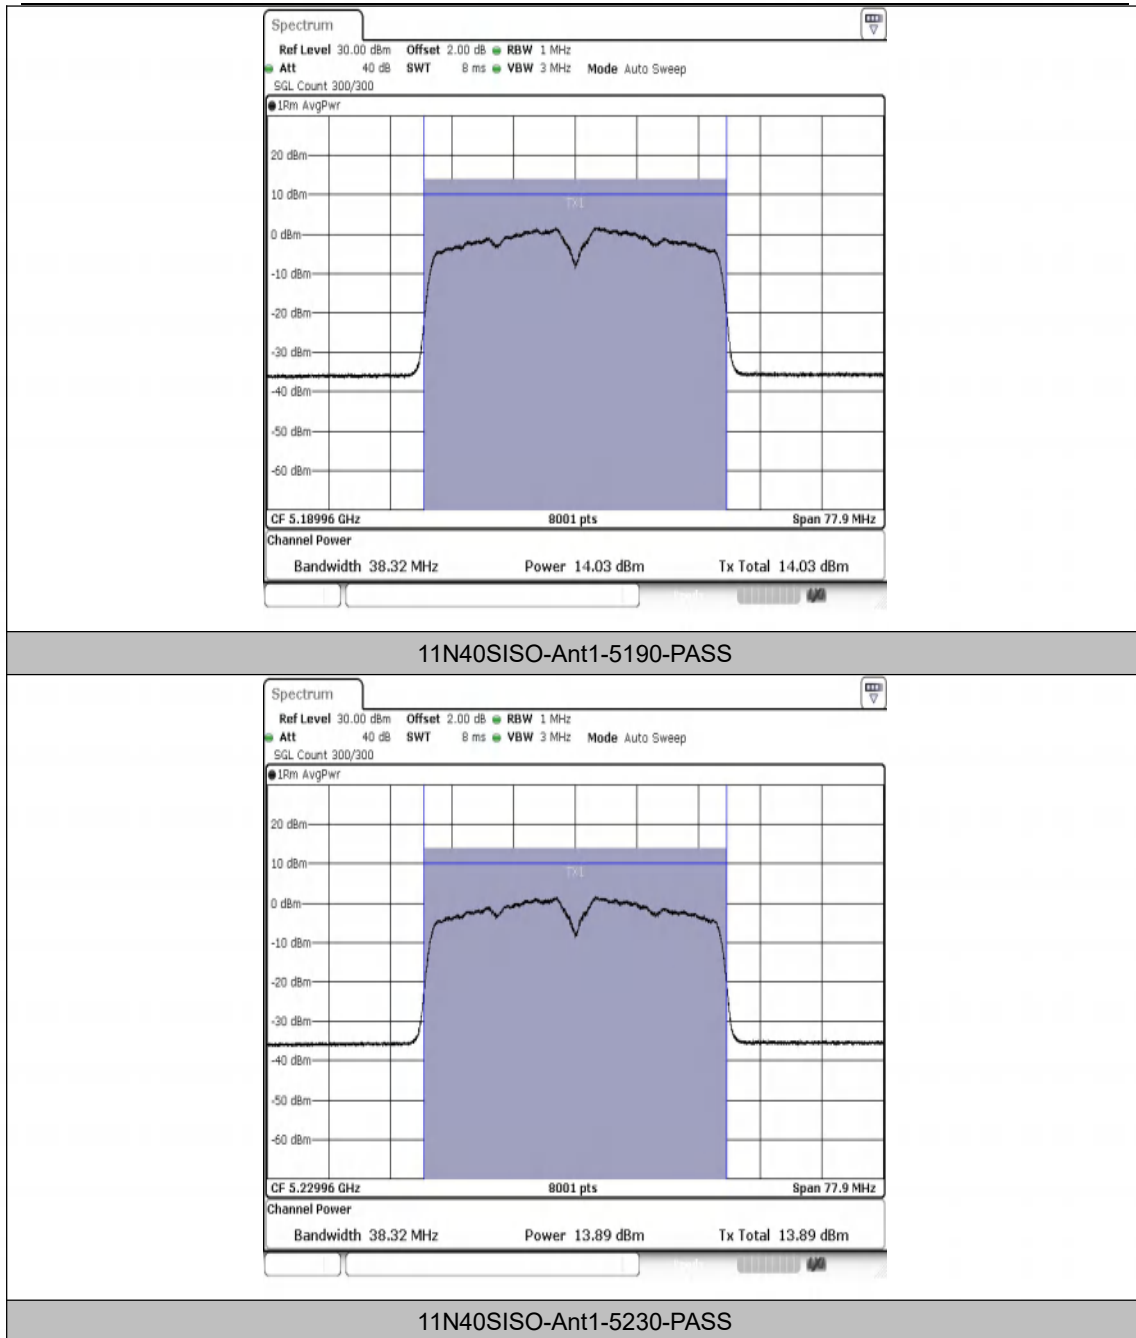



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

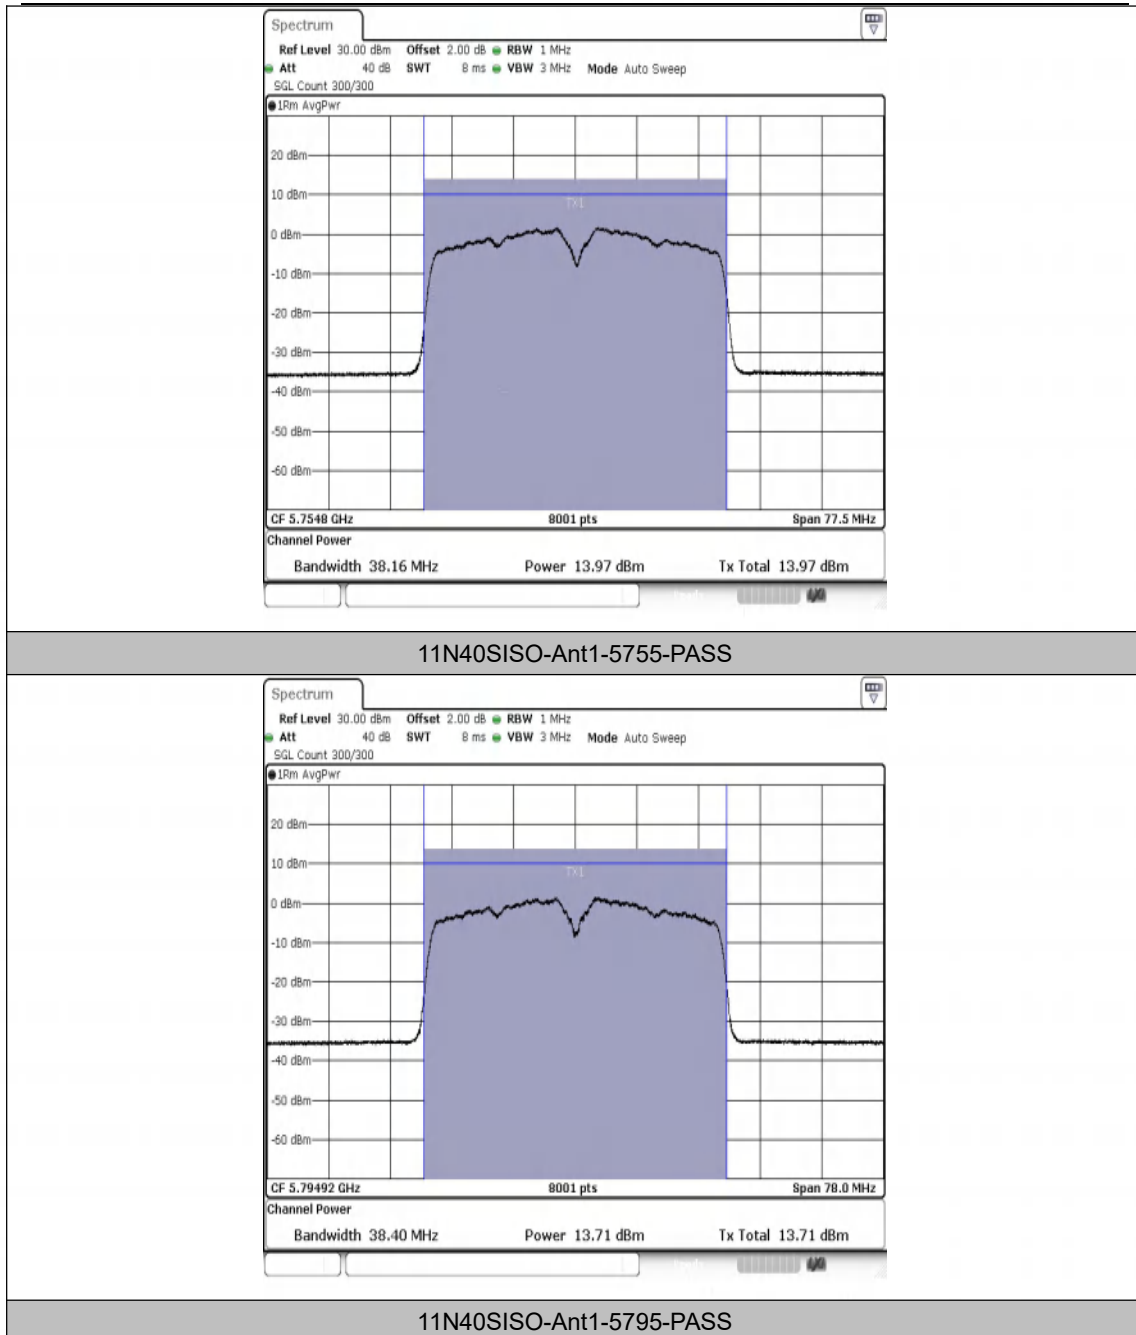


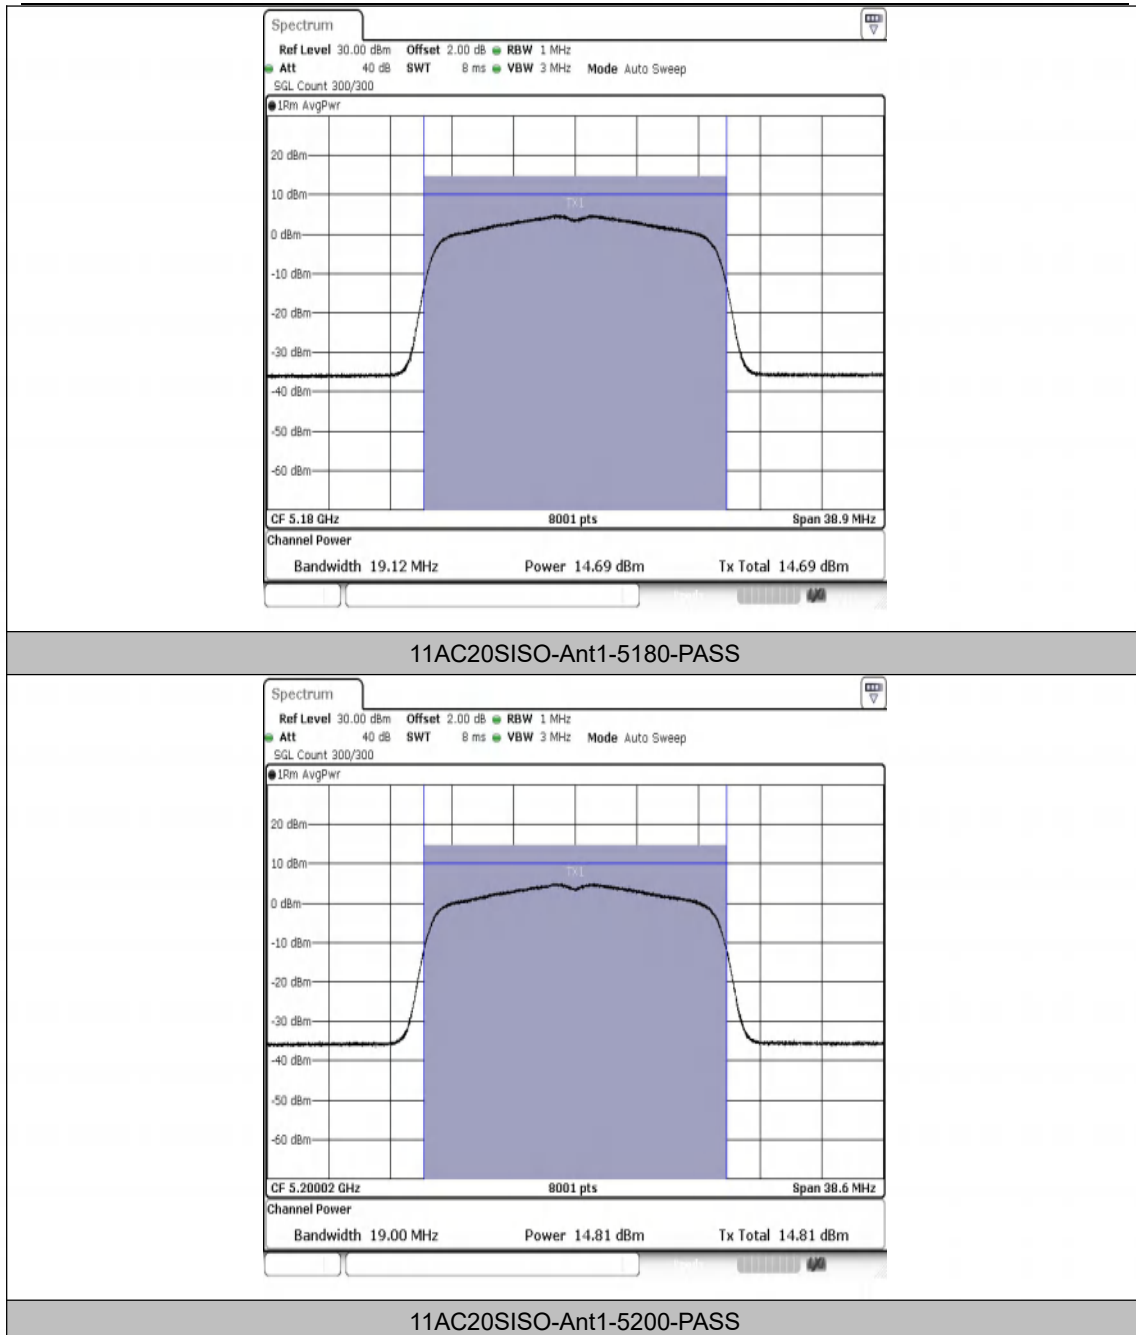


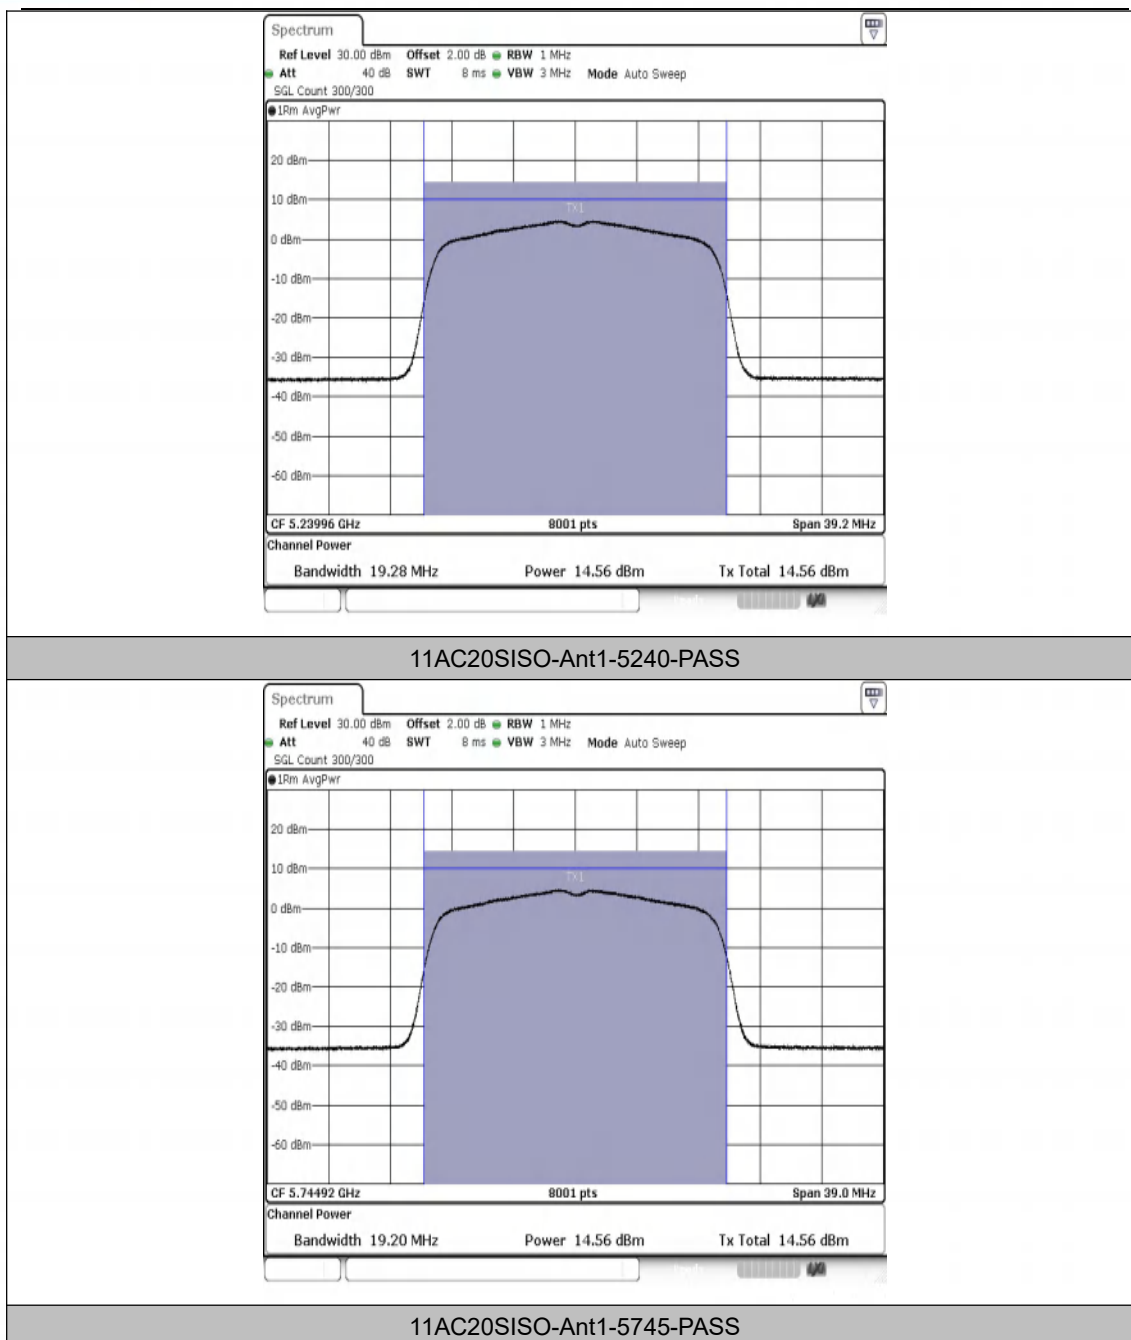


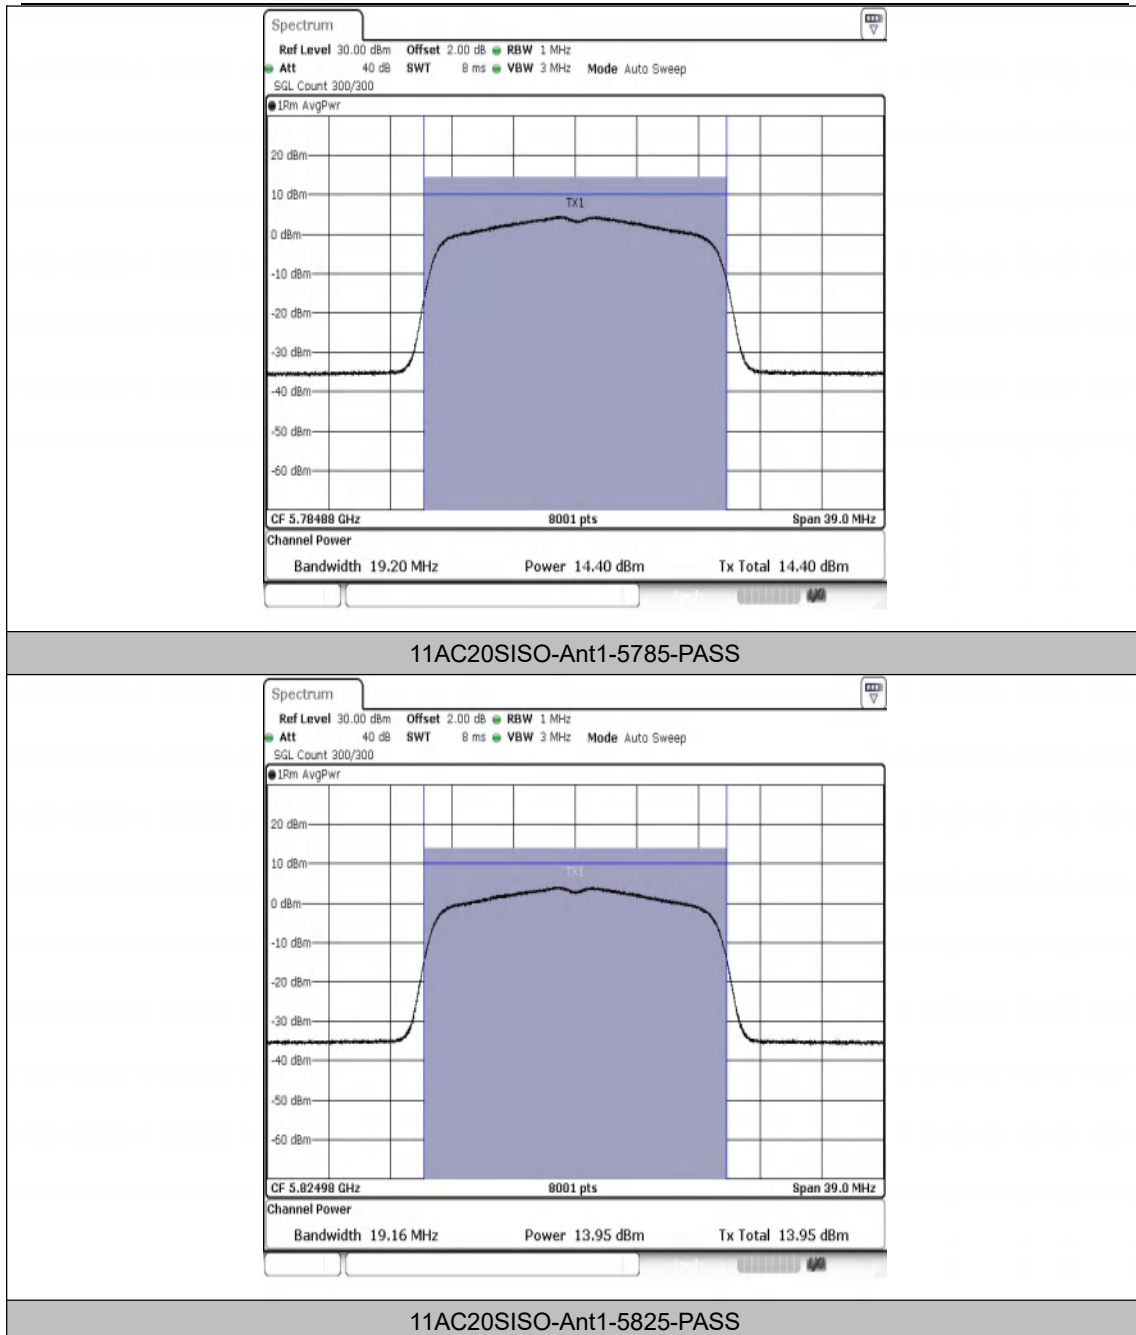


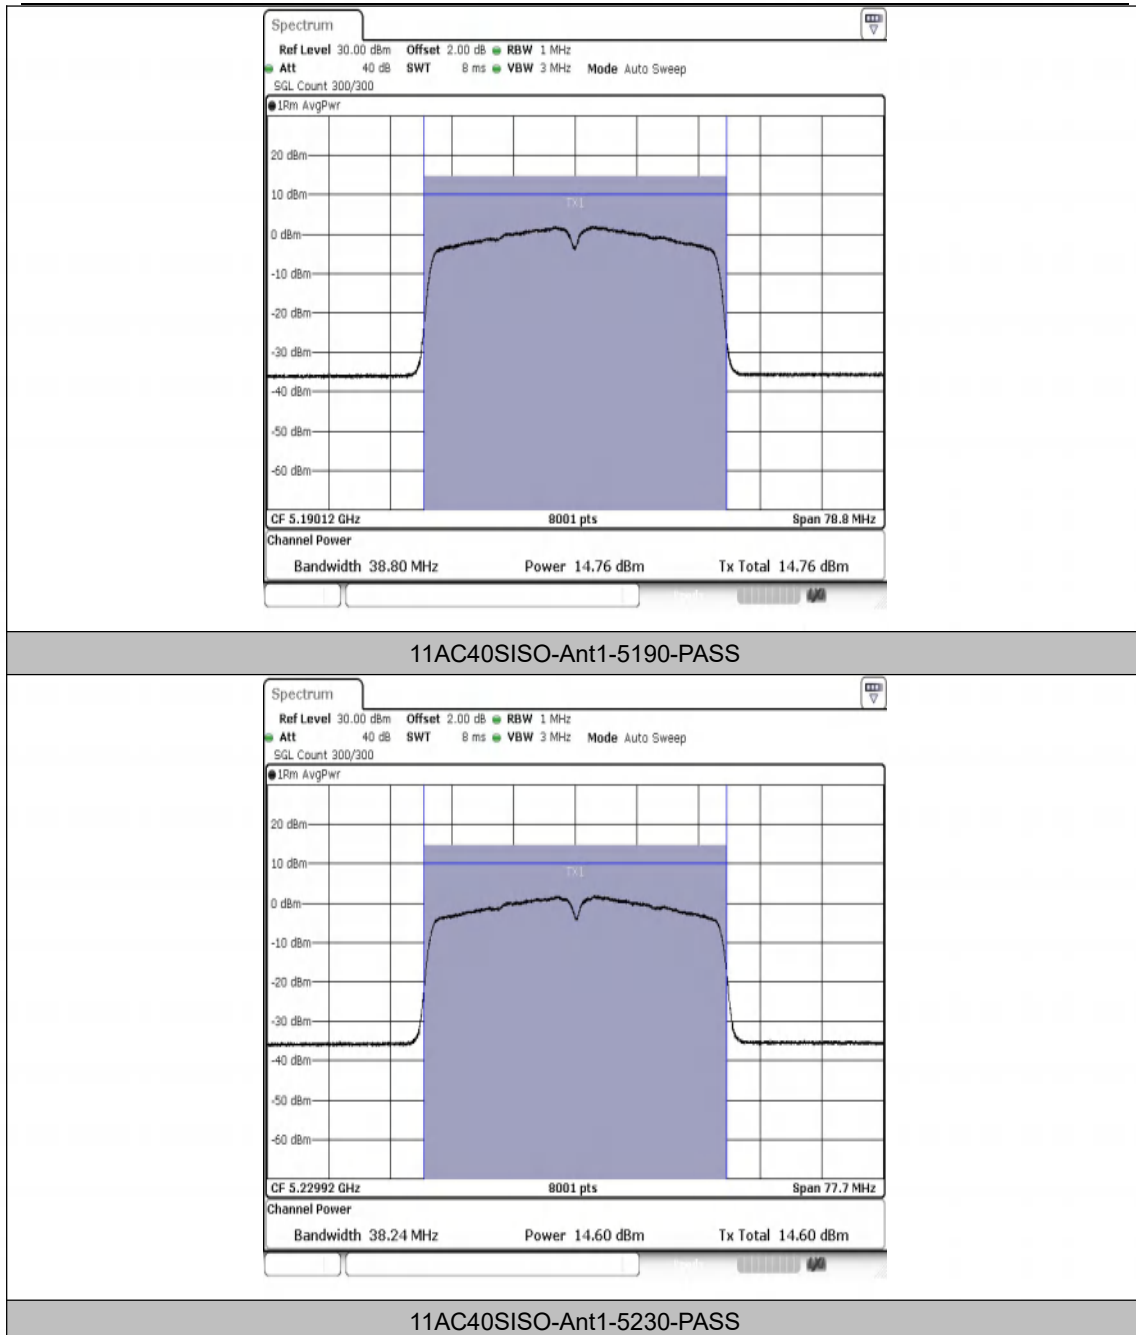


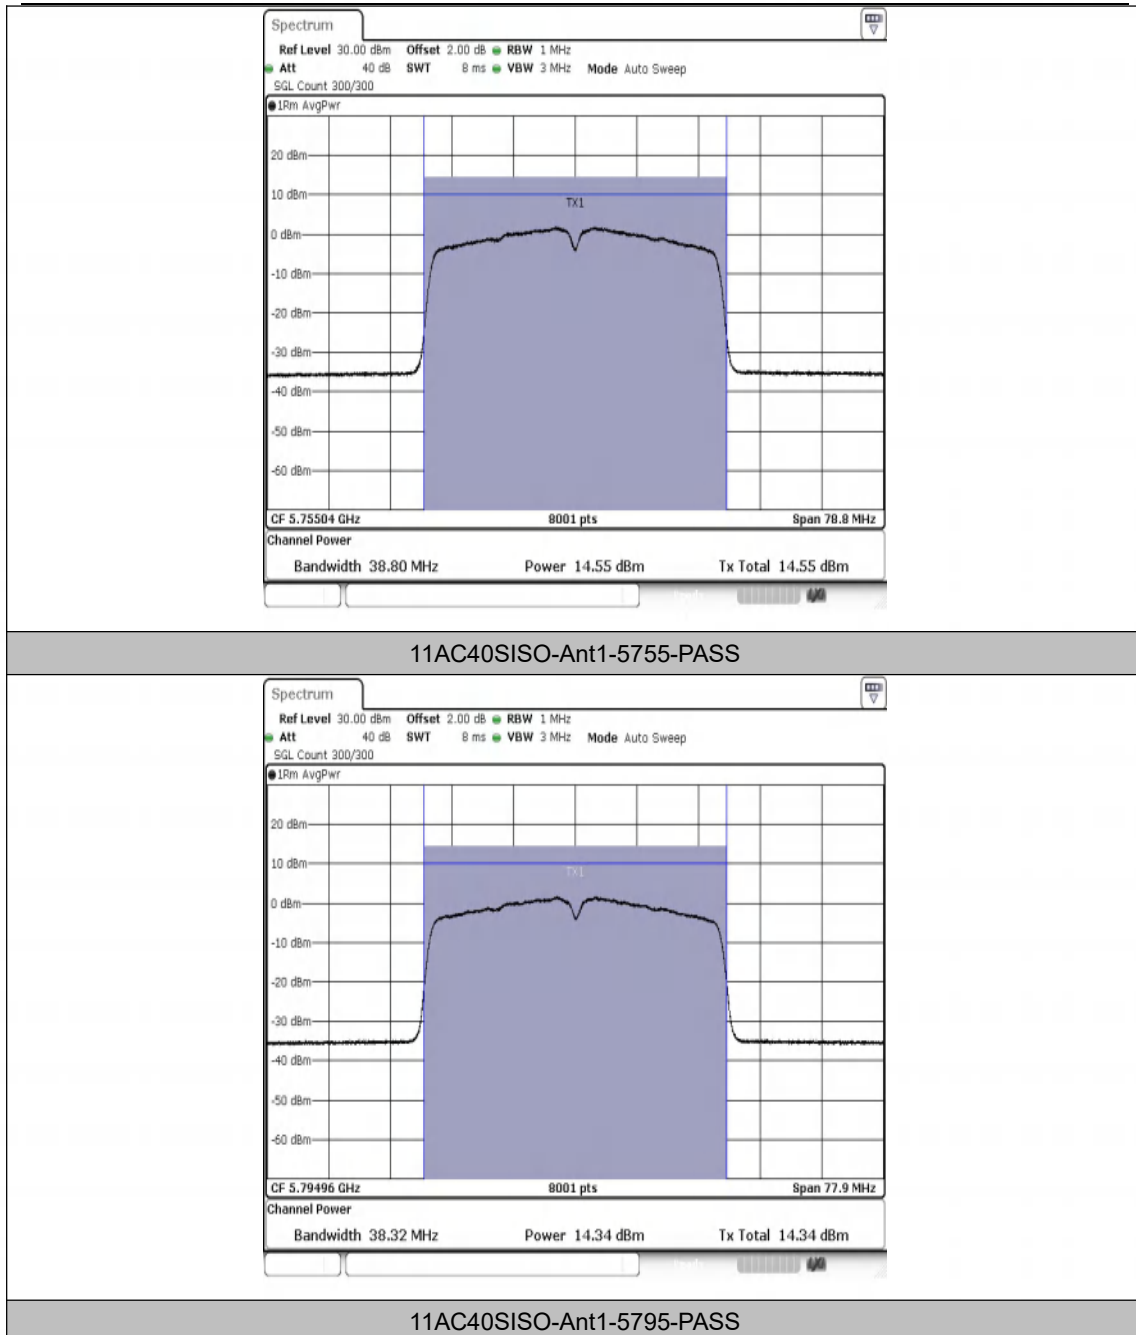


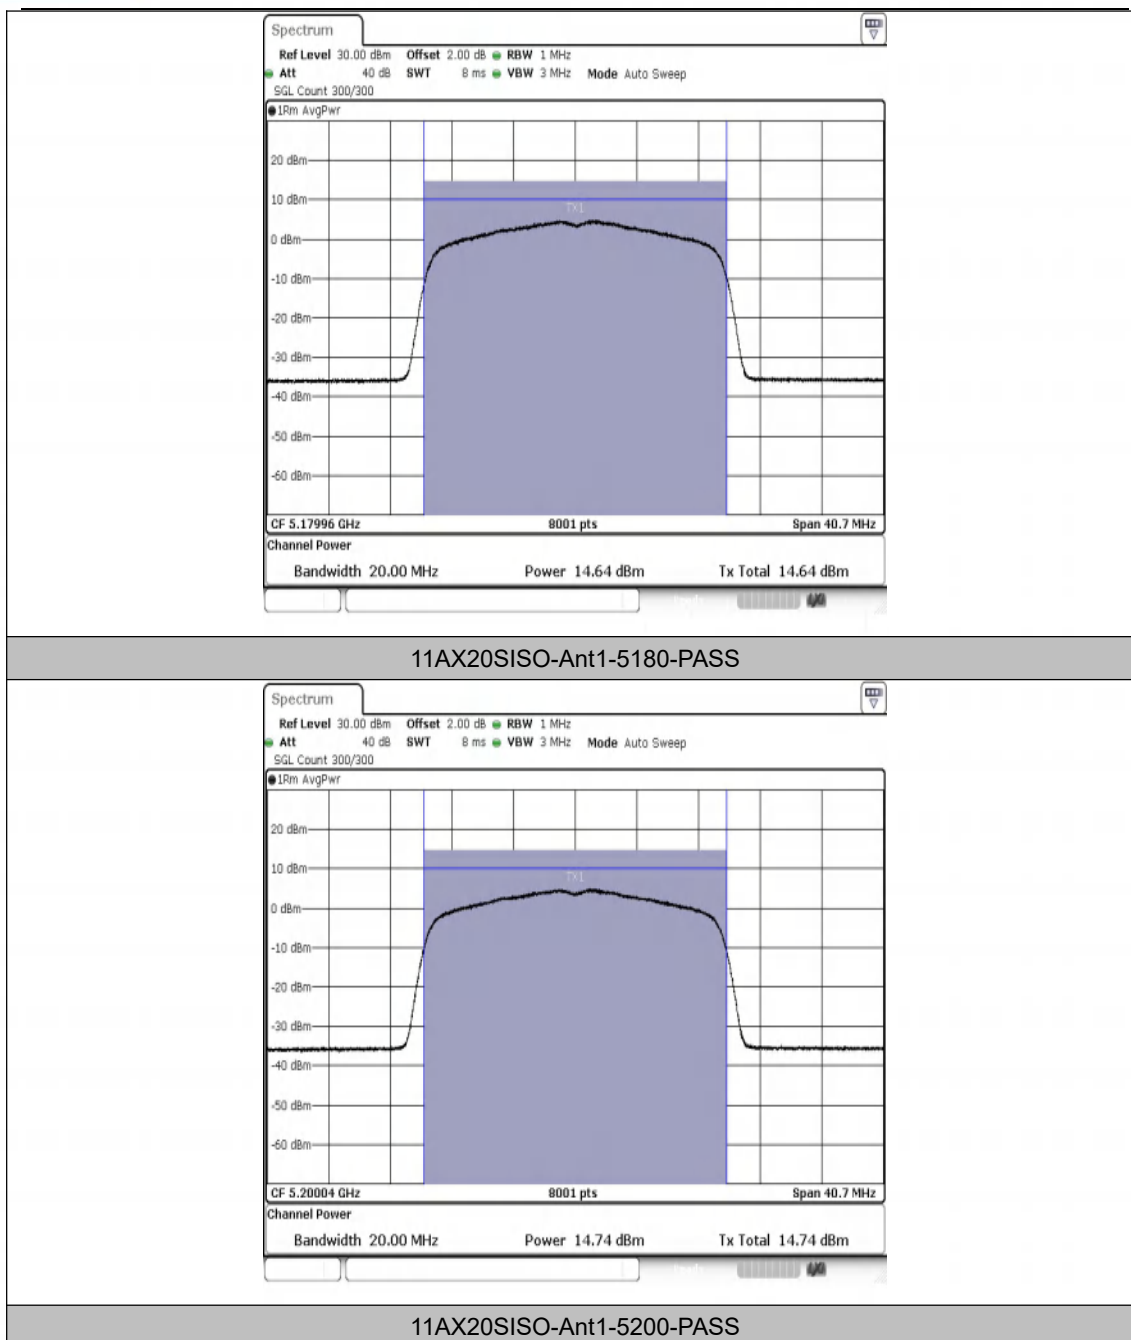

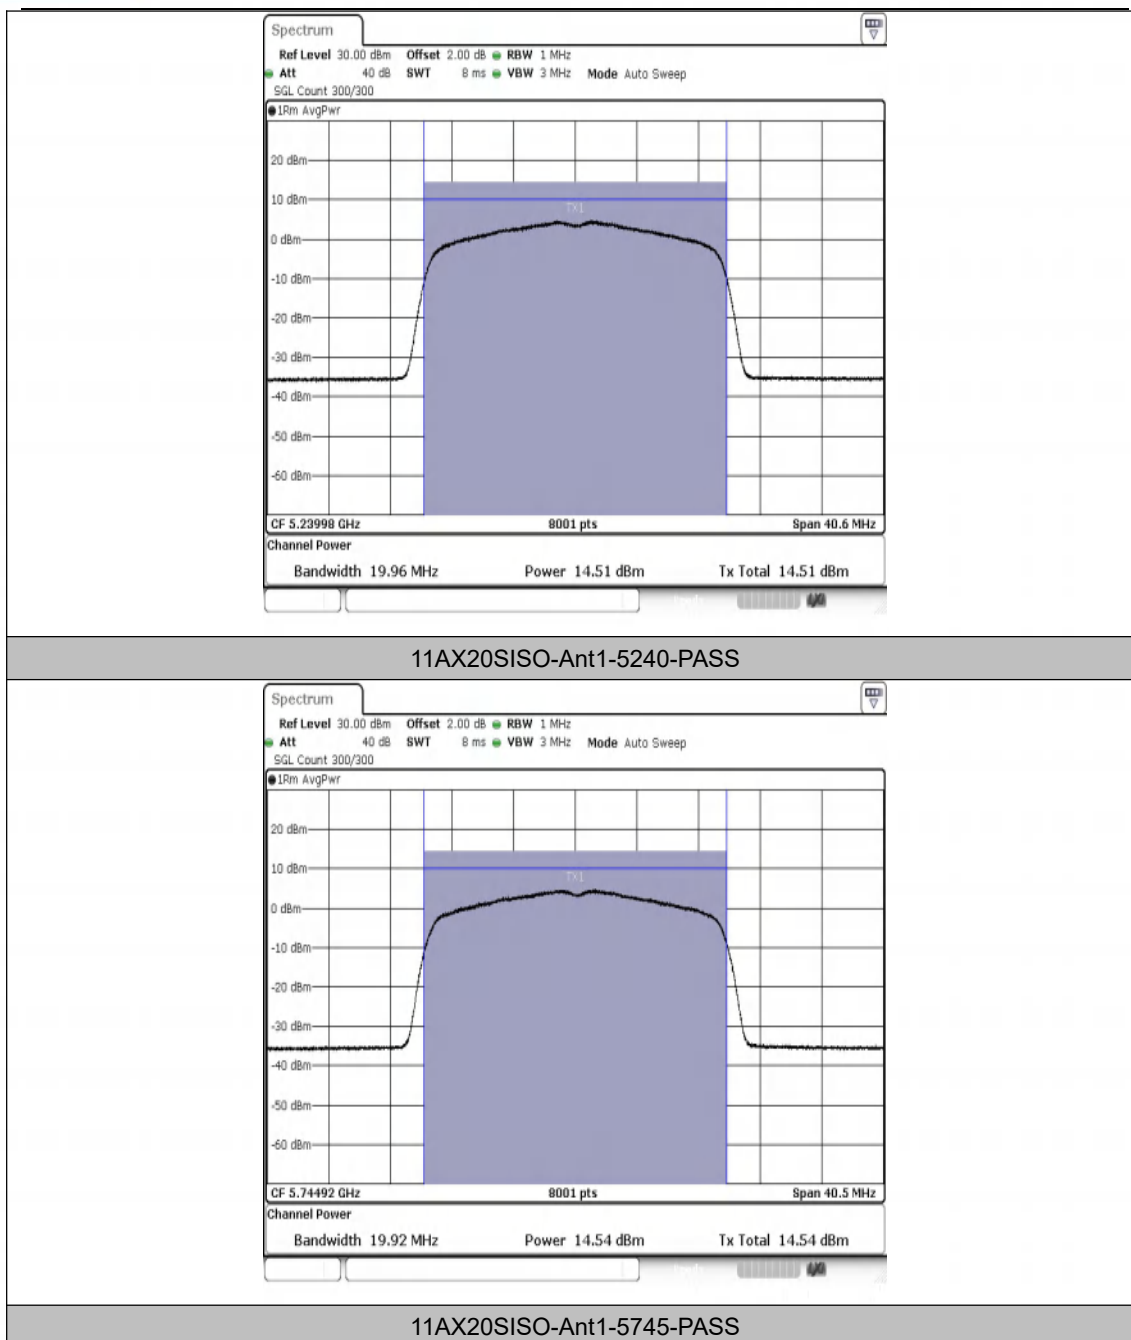

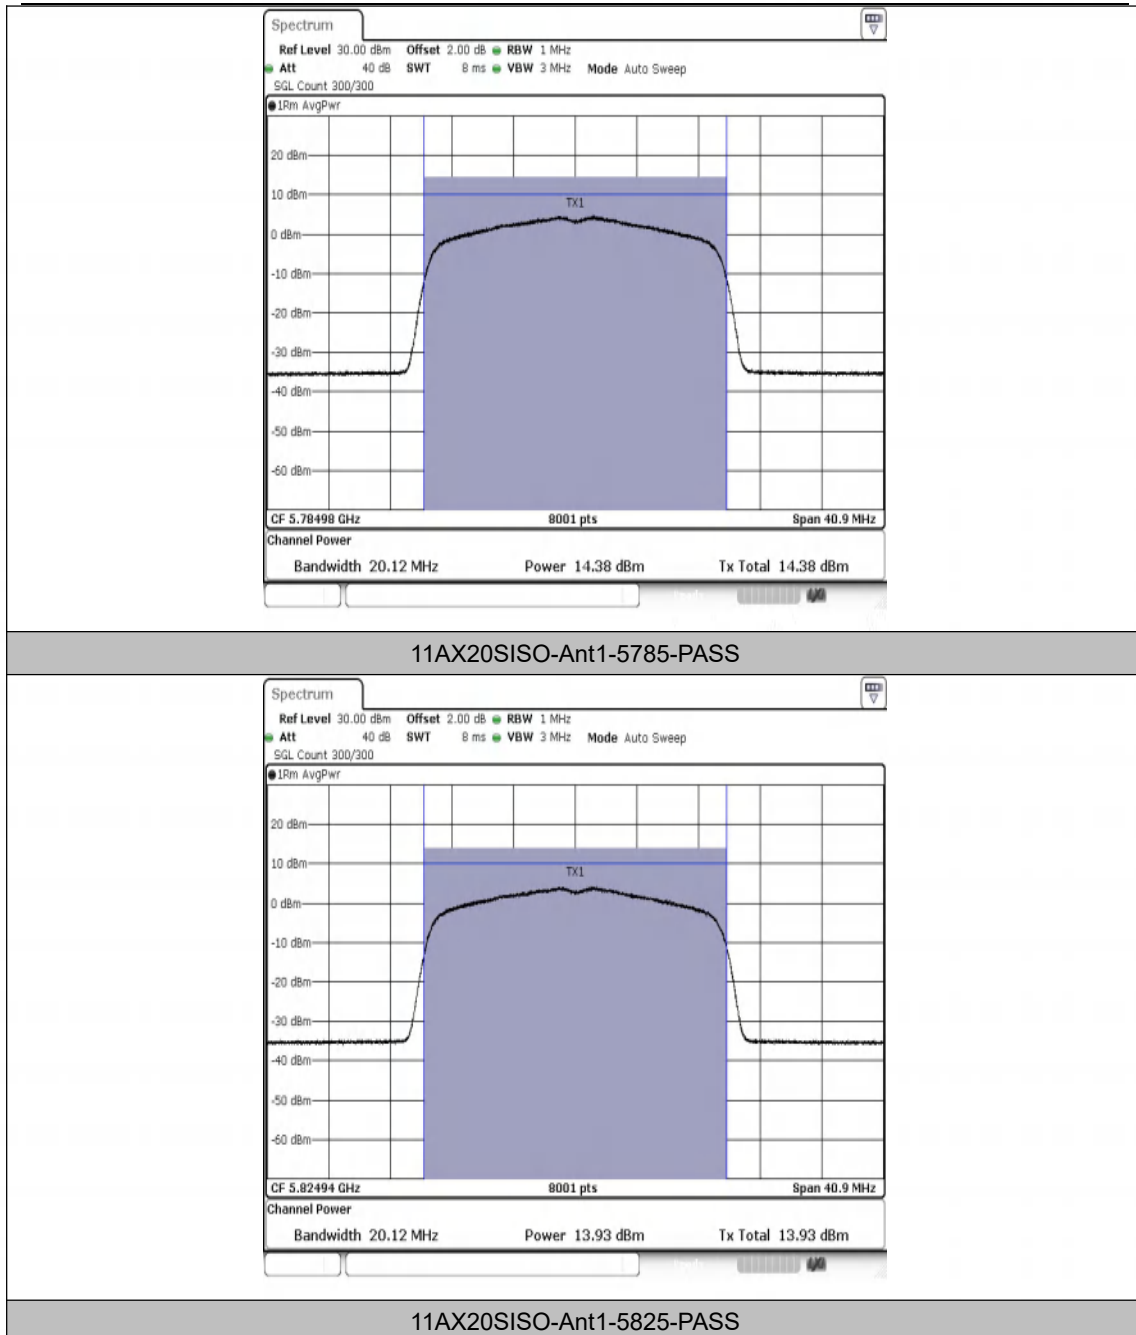

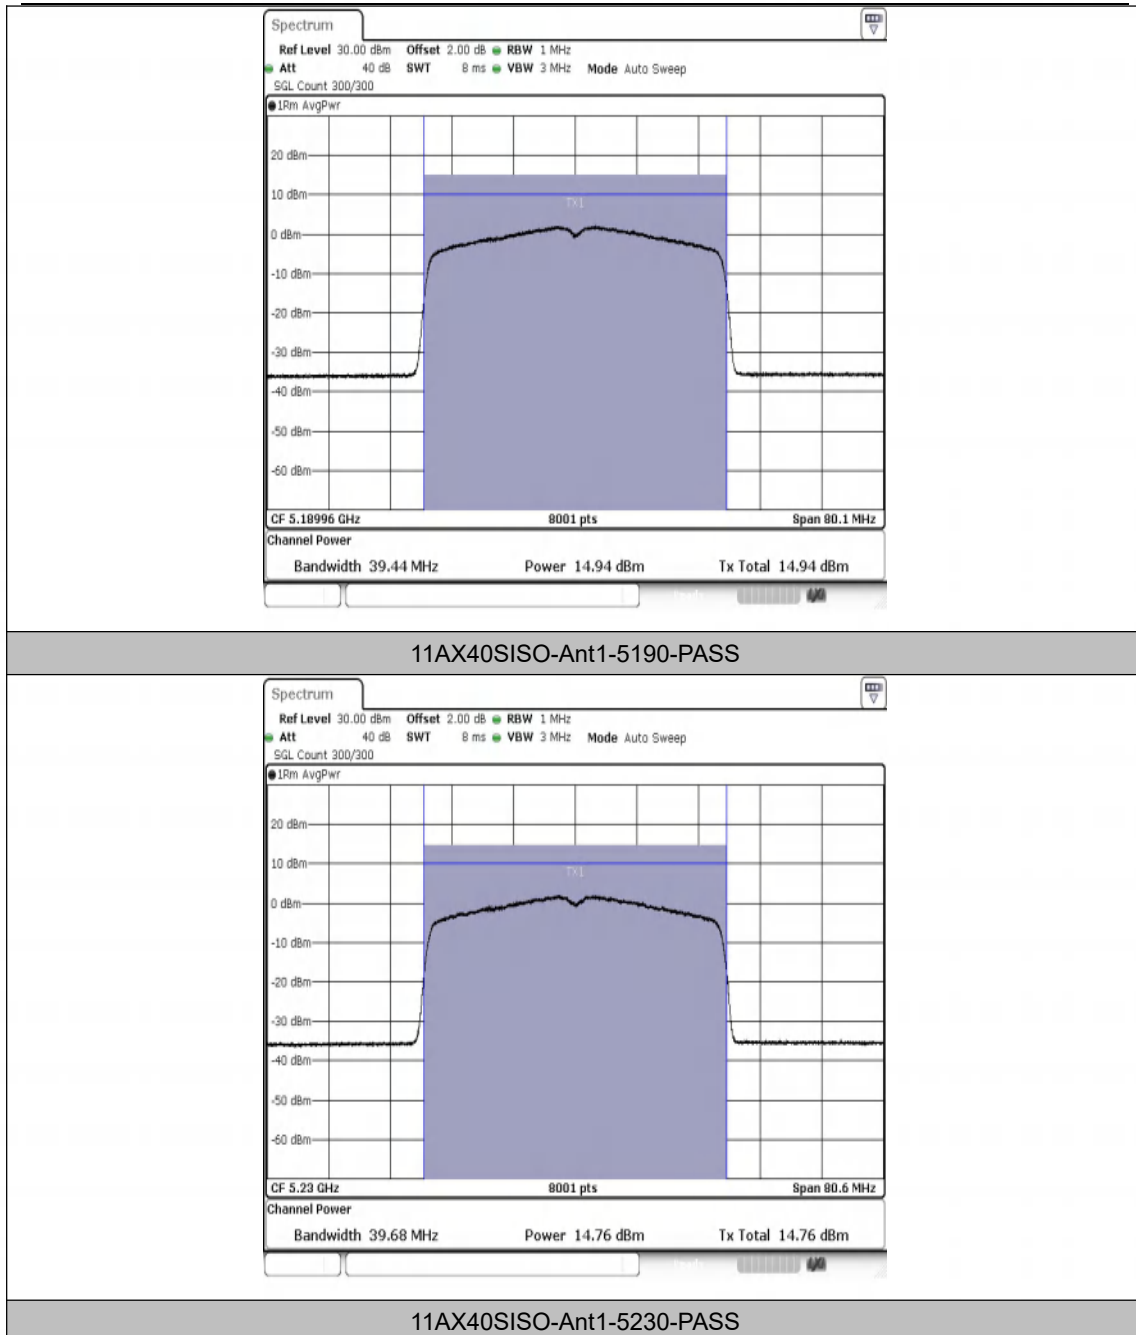

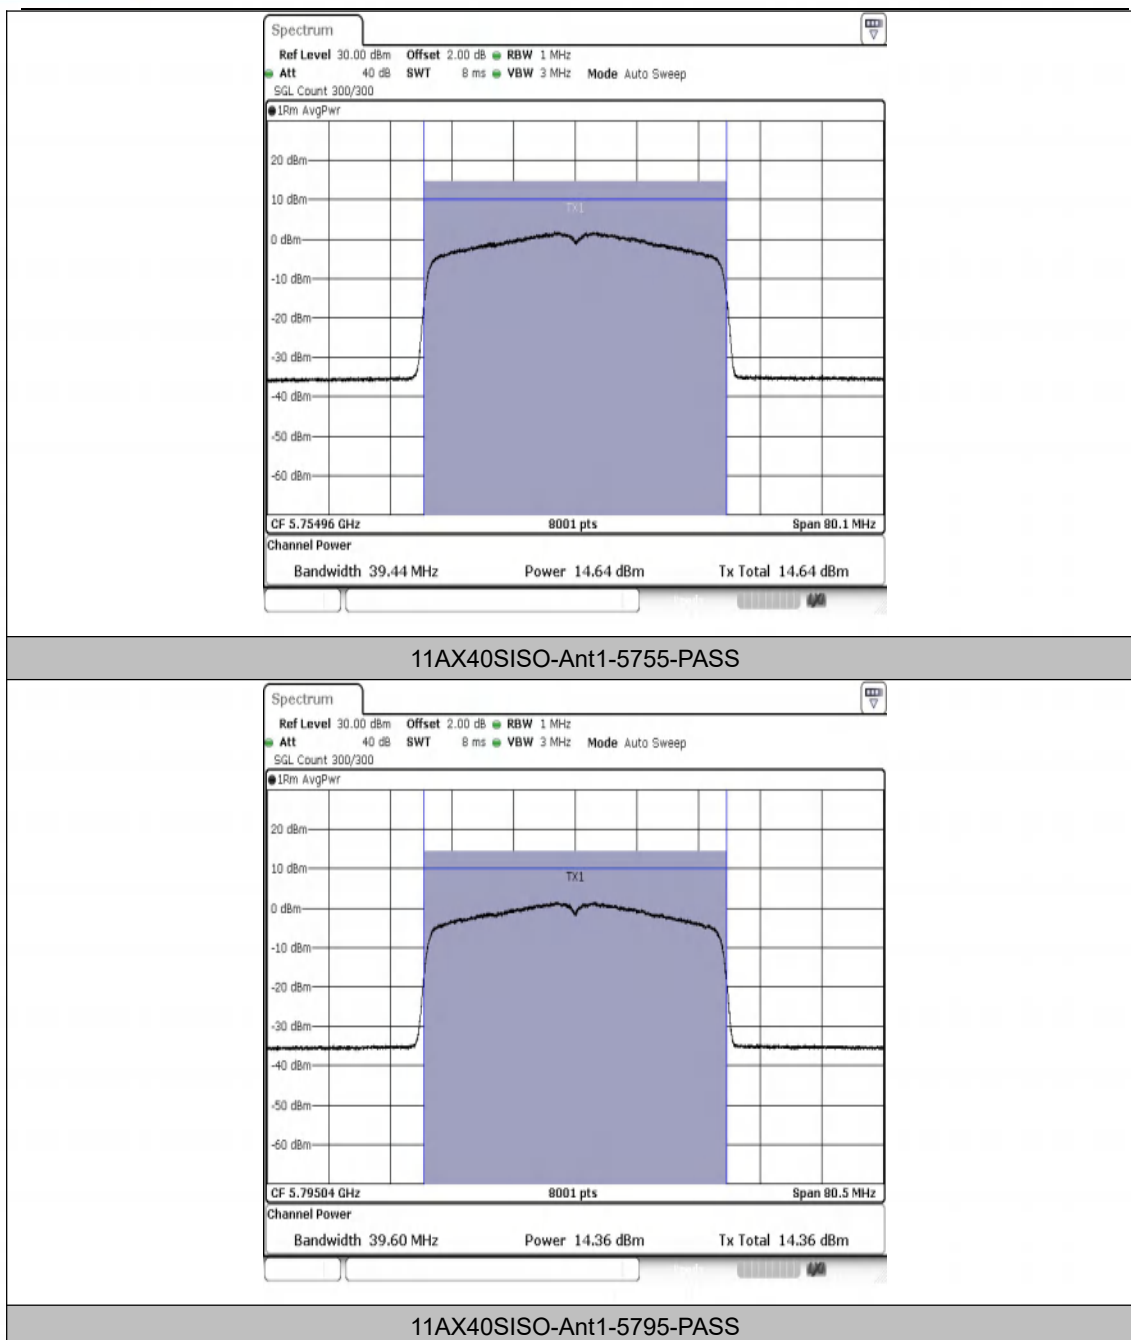

Appendix D: Maximum Power Spectral Density

Test Result B1

Test Mode	Antenna	Frequency[MHz]	Result [dBm/MHz]	Limit[dBm/MHz]	Verdict
11A	Ant1	5180	5.00	≤11.00	PASS
11A	Ant1	5200	5.24	≤11.00	PASS
11A	Ant1	5240	4.89	≤11.00	PASS
11N20SISO	Ant1	5180	4.87	≤11.00	PASS
11N20SISO	Ant1	5200	5.07	≤11.00	PASS
11N20SISO	Ant1	5240	4.63	≤11.00	PASS
11N40SISO	Ant1	5190	1.47	≤11.00	PASS
11N40SISO	Ant1	5230	1.41	≤11.00	PASS
11AC20SISO	Ant1	5180	4.44	≤11.00	PASS
11AC20SISO	Ant1	5200	4.75	≤11.00	PASS
11AC20SISO	Ant1	5240	5.06	≤11.00	PASS
11AC40SISO	Ant1	5190	2.16	≤11.00	PASS
11AC40SISO	Ant1	5230	1.96	≤11.00	PASS
11AX20SISO	Ant1	5180	4.24	≤11.00	PASS
11AX20SISO	Ant1	5200	5.05	≤11.00	PASS
11AX20SISO	Ant1	5240	4.59	≤11.00	PASS
11AX40SISO	Ant1	5190	1.94	≤11.00	PASS
11AX40SISO	Ant1	5230	1.97	≤11.00	PASS


Note: 1.The cable loss are compensated in the graph.

Test Result B4

Test Mode	Antenna	Frequency[MHz]	Result [dBm/500KHz]	Limit[dBm/500KHz]	Verdict
11A	Ant1	5745	2.19	≤30.00	PASS
11A	Ant1	5785	1.83	≤30.00	PASS
11A	Ant1	5825	1.45	≤30.00	PASS
11N20SISO	Ant1	5745	2.42	≤30.00	PASS
11N20SISO	Ant1	5785	2.30	≤30.00	PASS
11N20SISO	Ant1	5825	1.92	≤30.00	PASS
11N40SISO	Ant1	5755	0.00	≤30.00	PASS
11N40SISO	Ant1	5795	-0.42	≤30.00	PASS
11AC20SISO	Ant1	5745	1.75	≤30.00	PASS
11AC20SISO	Ant1	5785	1.74	≤30.00	PASS
11AC20SISO	Ant1	5825	1.25	≤30.00	PASS
11AC40SISO	Ant1	5755	-0.42	≤30.00	PASS
11AC40SISO	Ant1	5795	-0.78	≤30.00	PASS
11AX20SISO	Ant1	5745	1.49	≤30.00	PASS
11AX20SISO	Ant1	5785	1.49	≤30.00	PASS
11AX20SISO	Ant1	5825	1.83	≤30.00	PASS
11AX40SISO	Ant1	5755	-0.92	≤30.00	PASS
11AX40SISO	Ant1	5795	-0.79	≤30.00	PASS

Note: 1.The cable loss are compensated in the graph.


Test Graphs B1

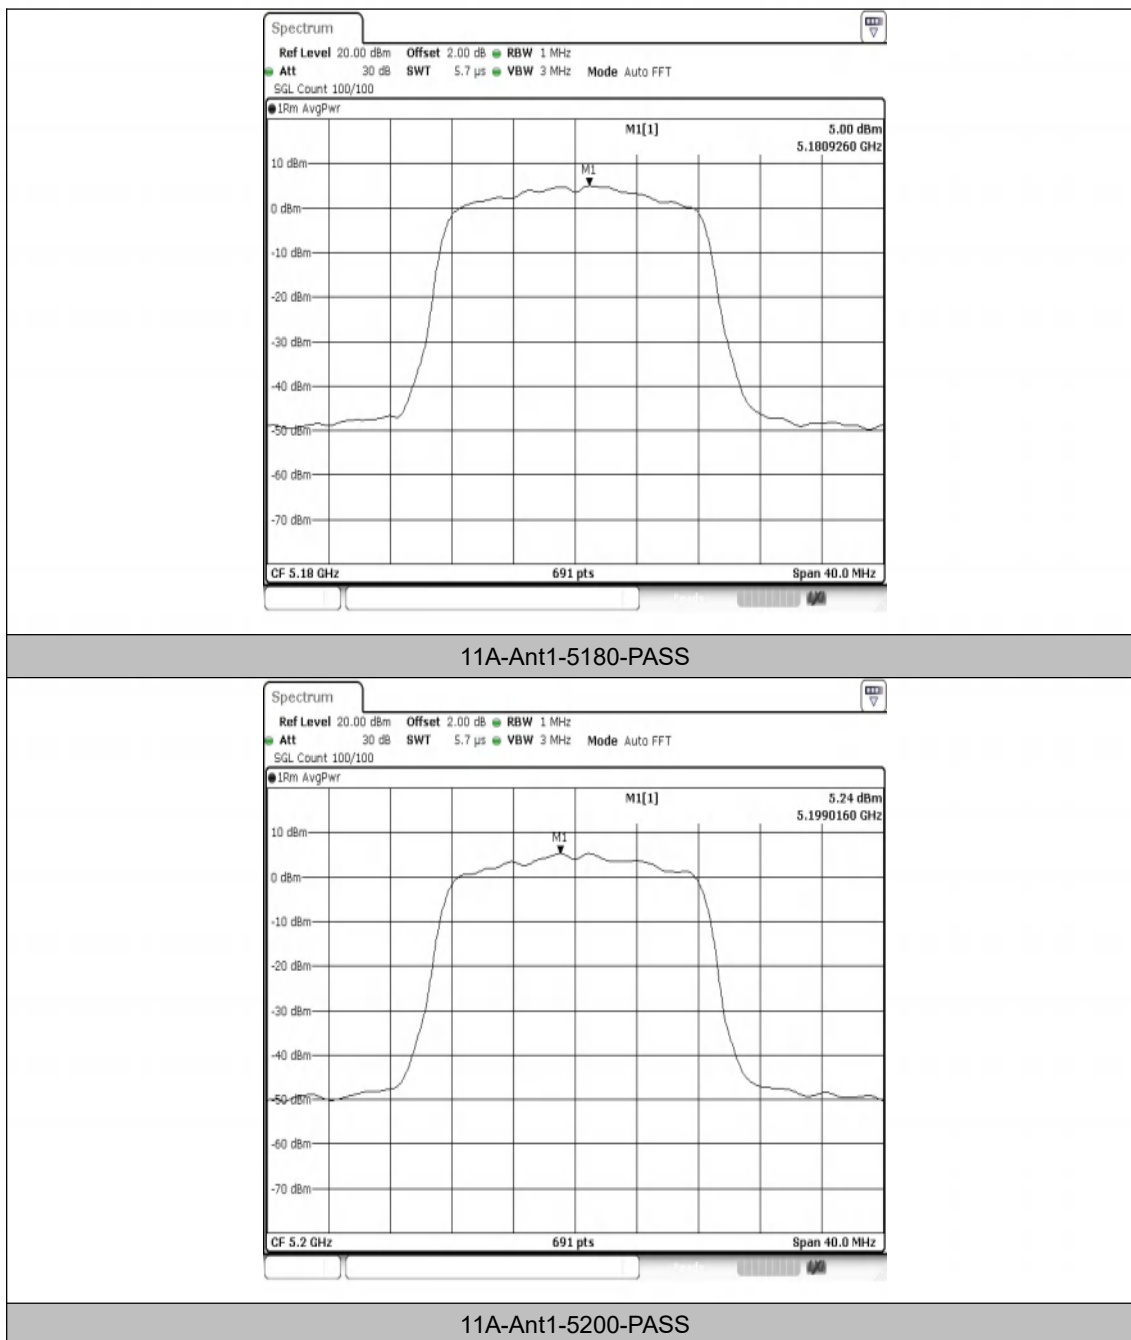



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

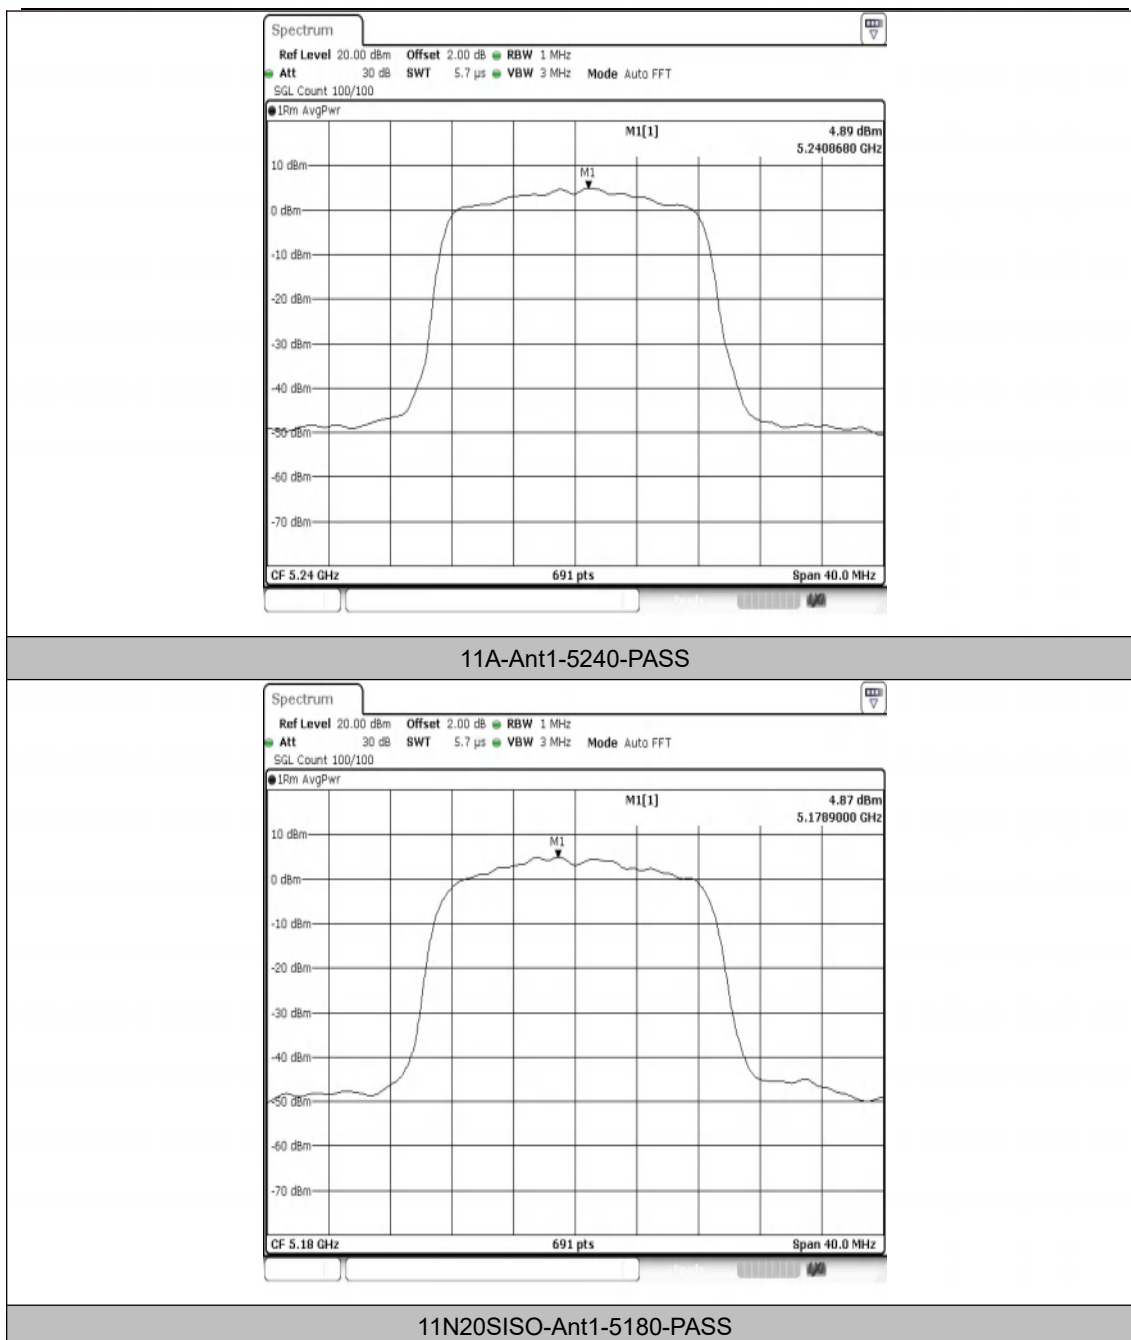

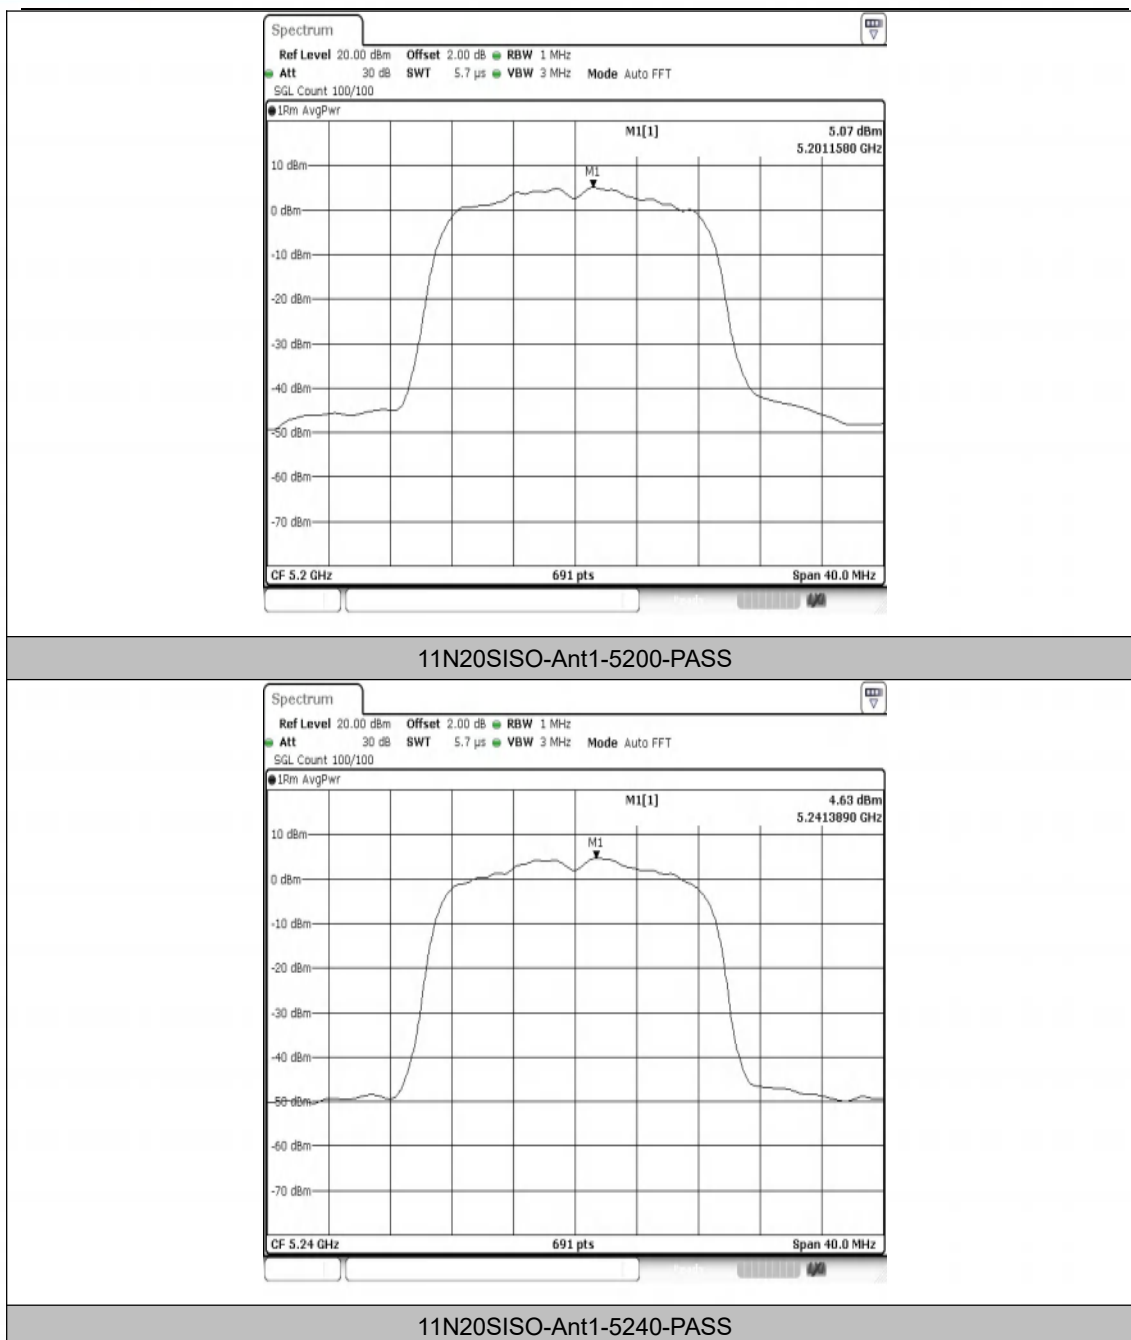


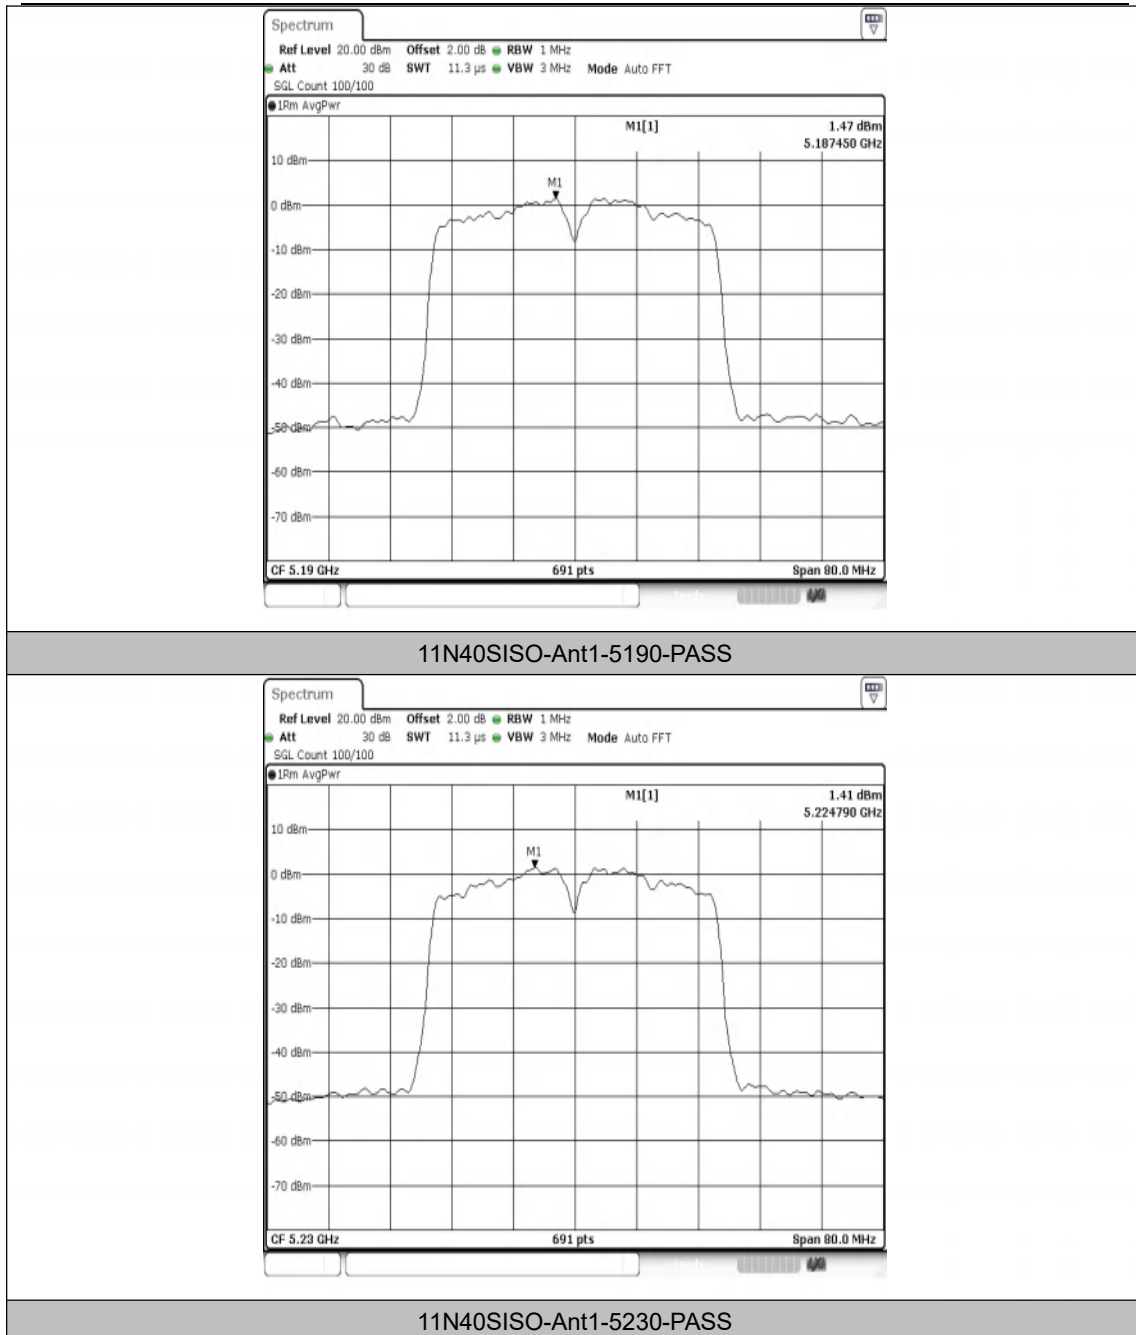


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

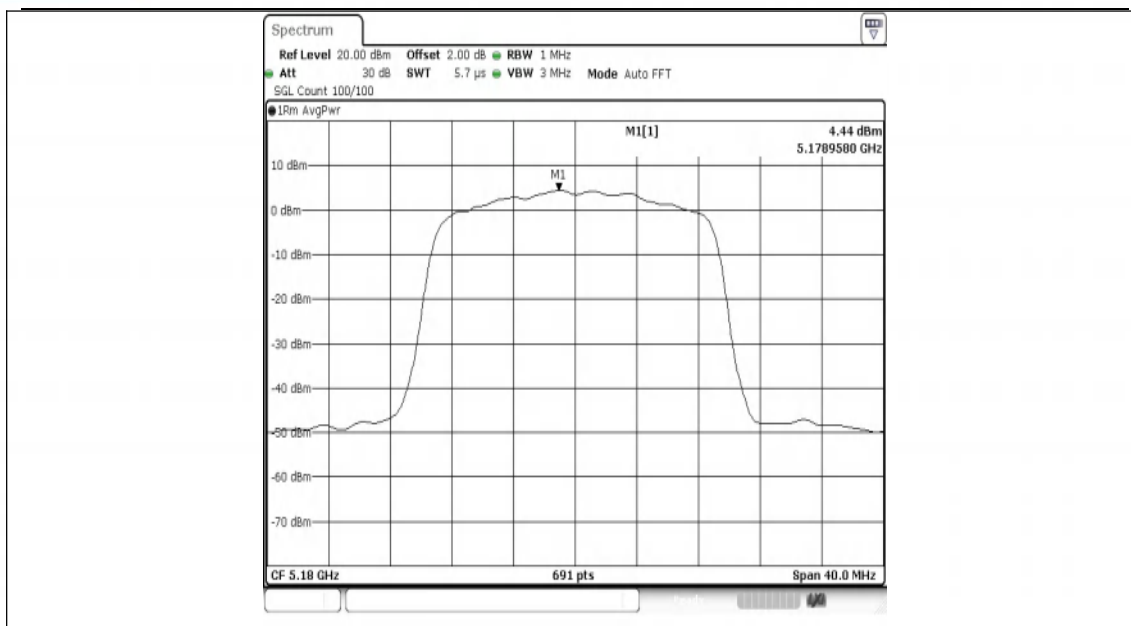


11AC20SISO-Ant1-5180-PASS

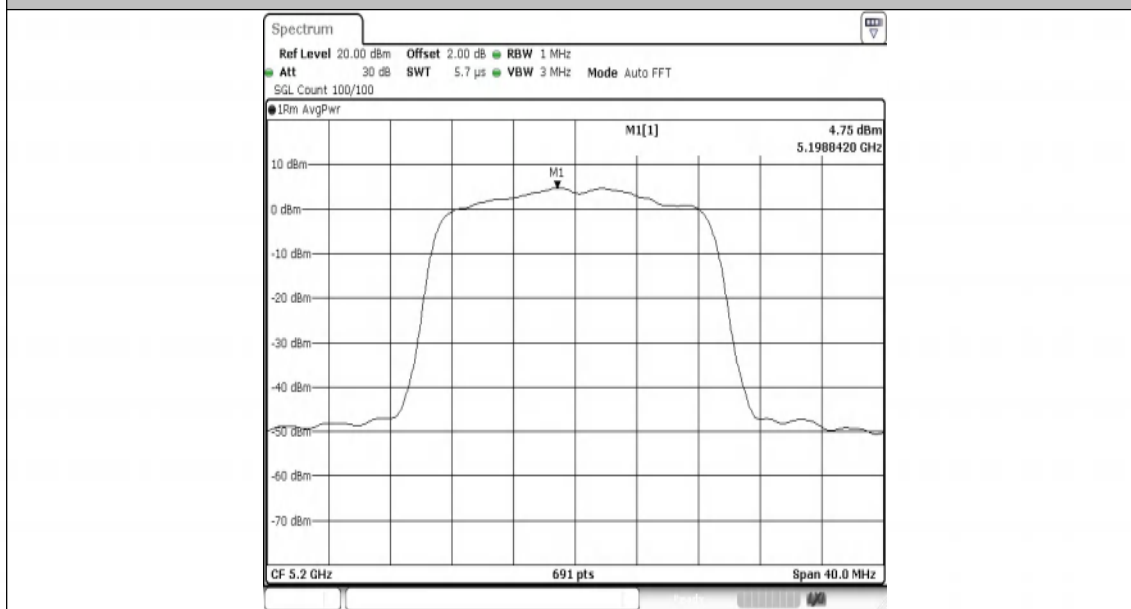


11AC20SISO-Ant1-5200-PASS

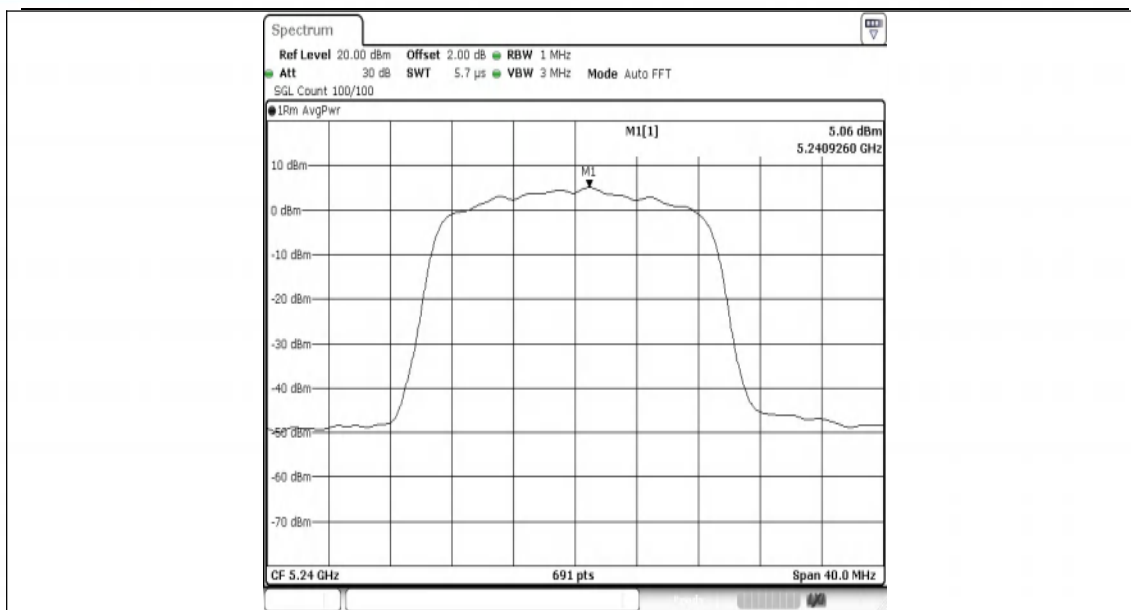


11AC20SISO-Ant1-5240-PASS

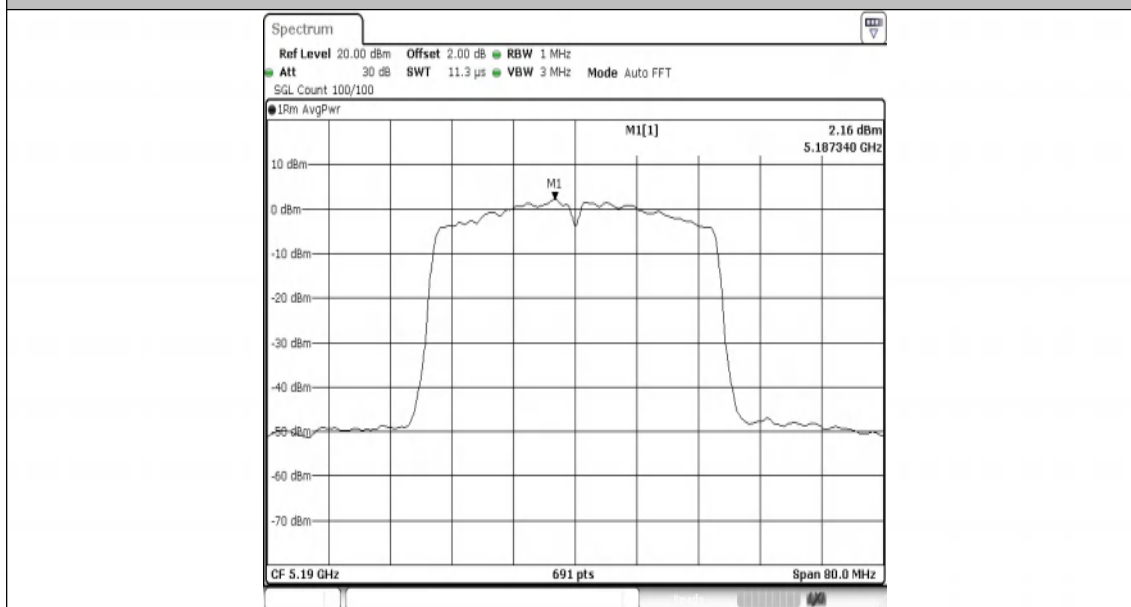


11AC40SISO-Ant1-5190-PASS

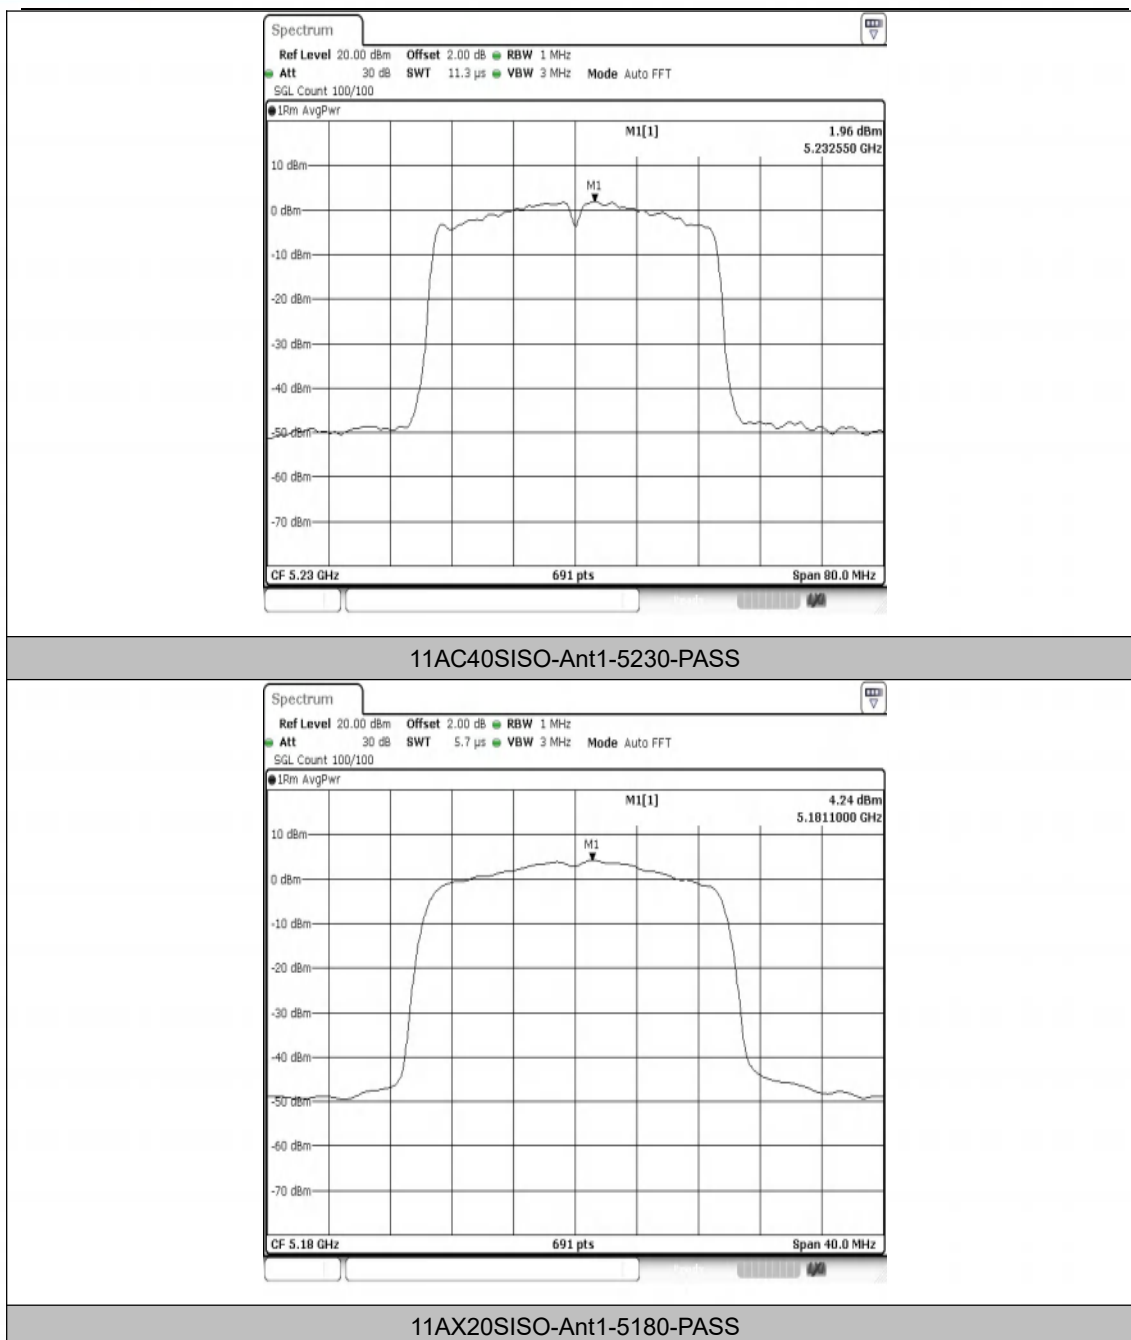


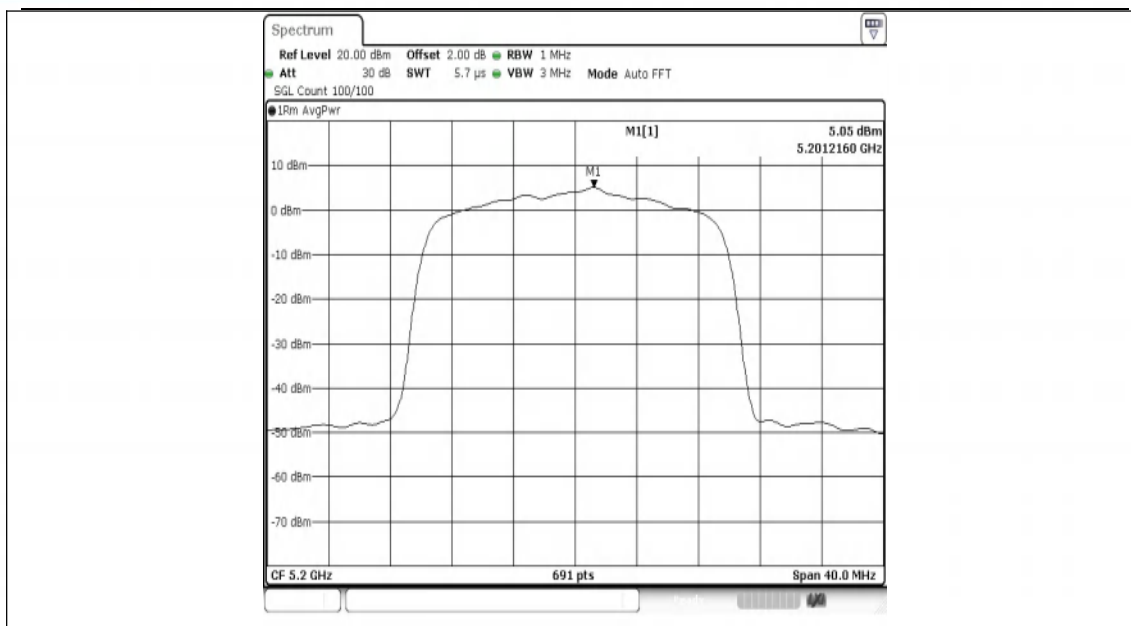


11AX20SISO-Ant1-5200-PASS

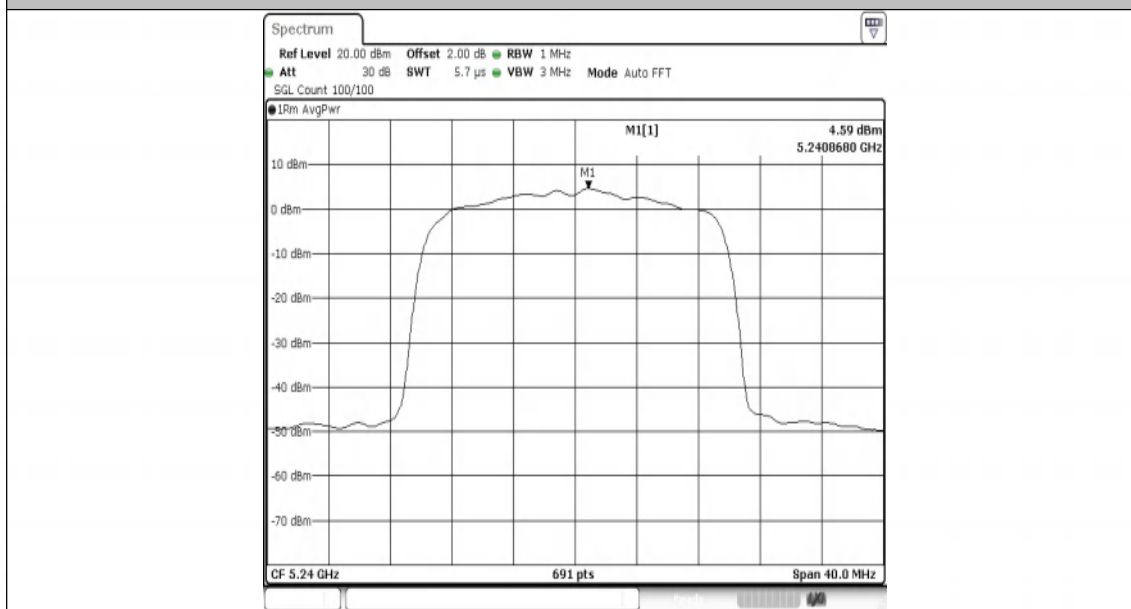


11AX20SISO-Ant1-5240-PASS

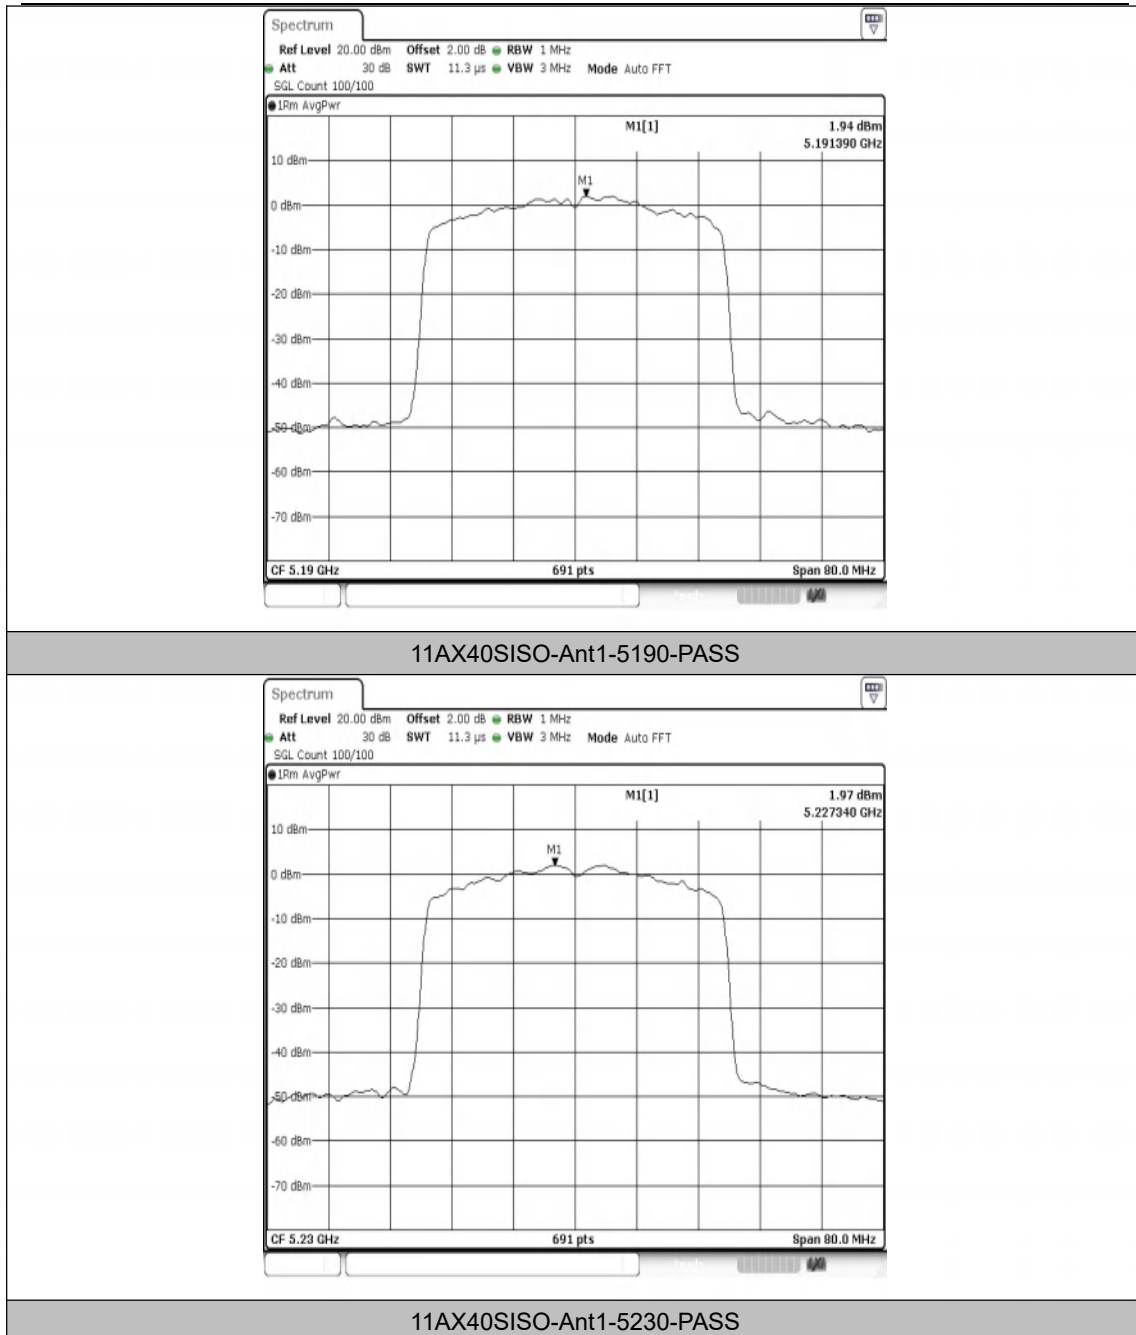

Test Graphs B4

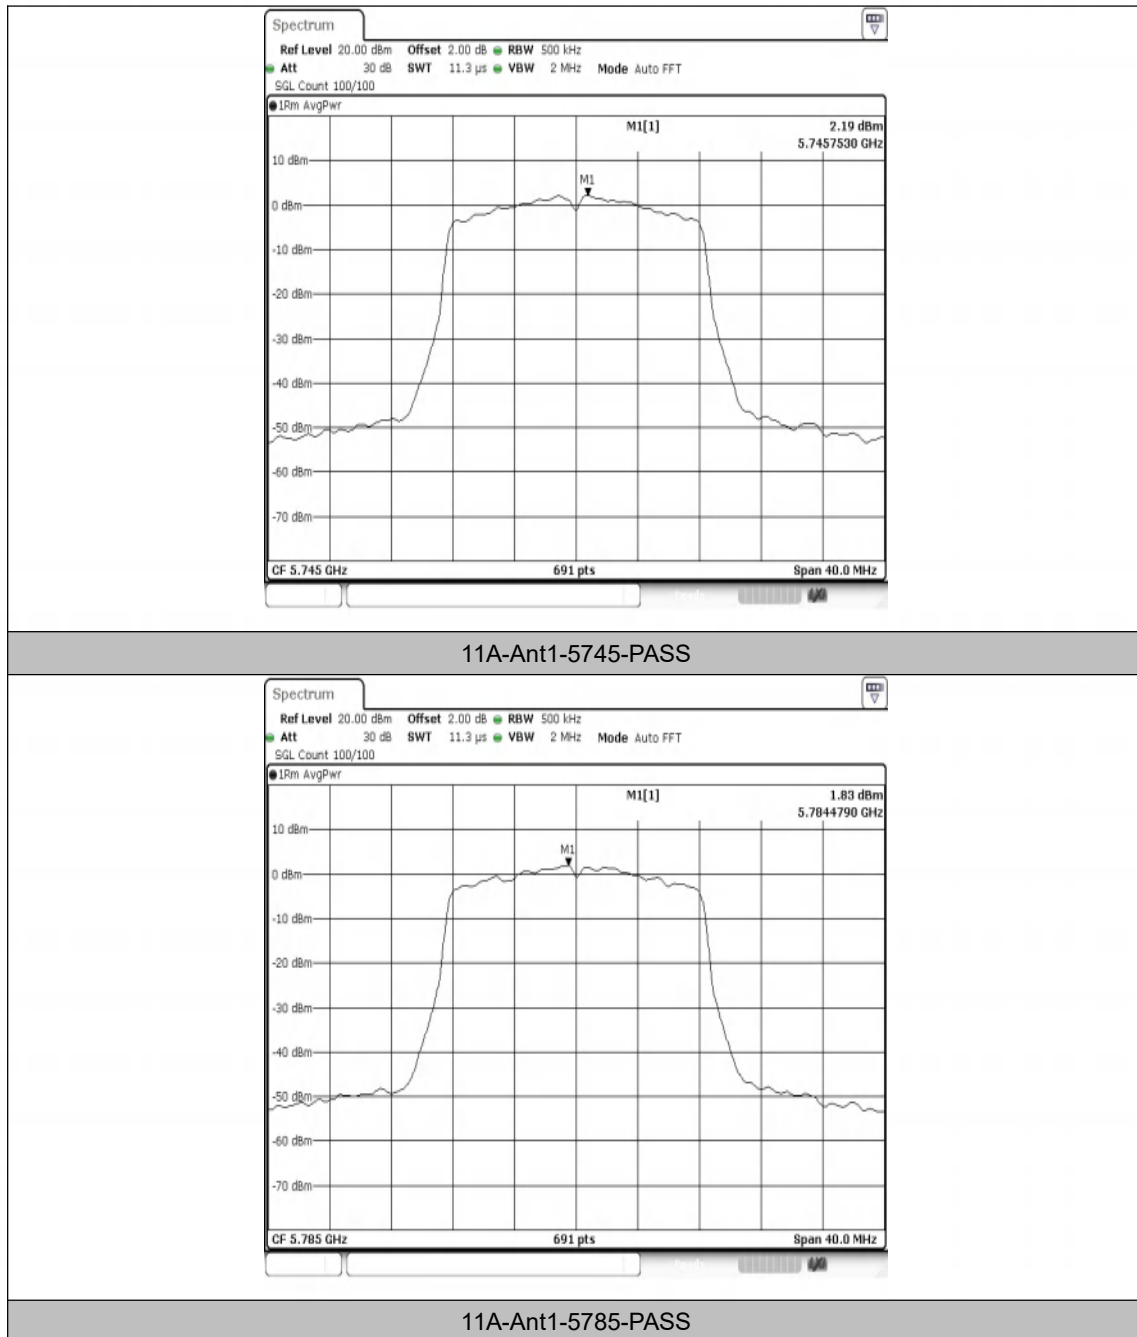


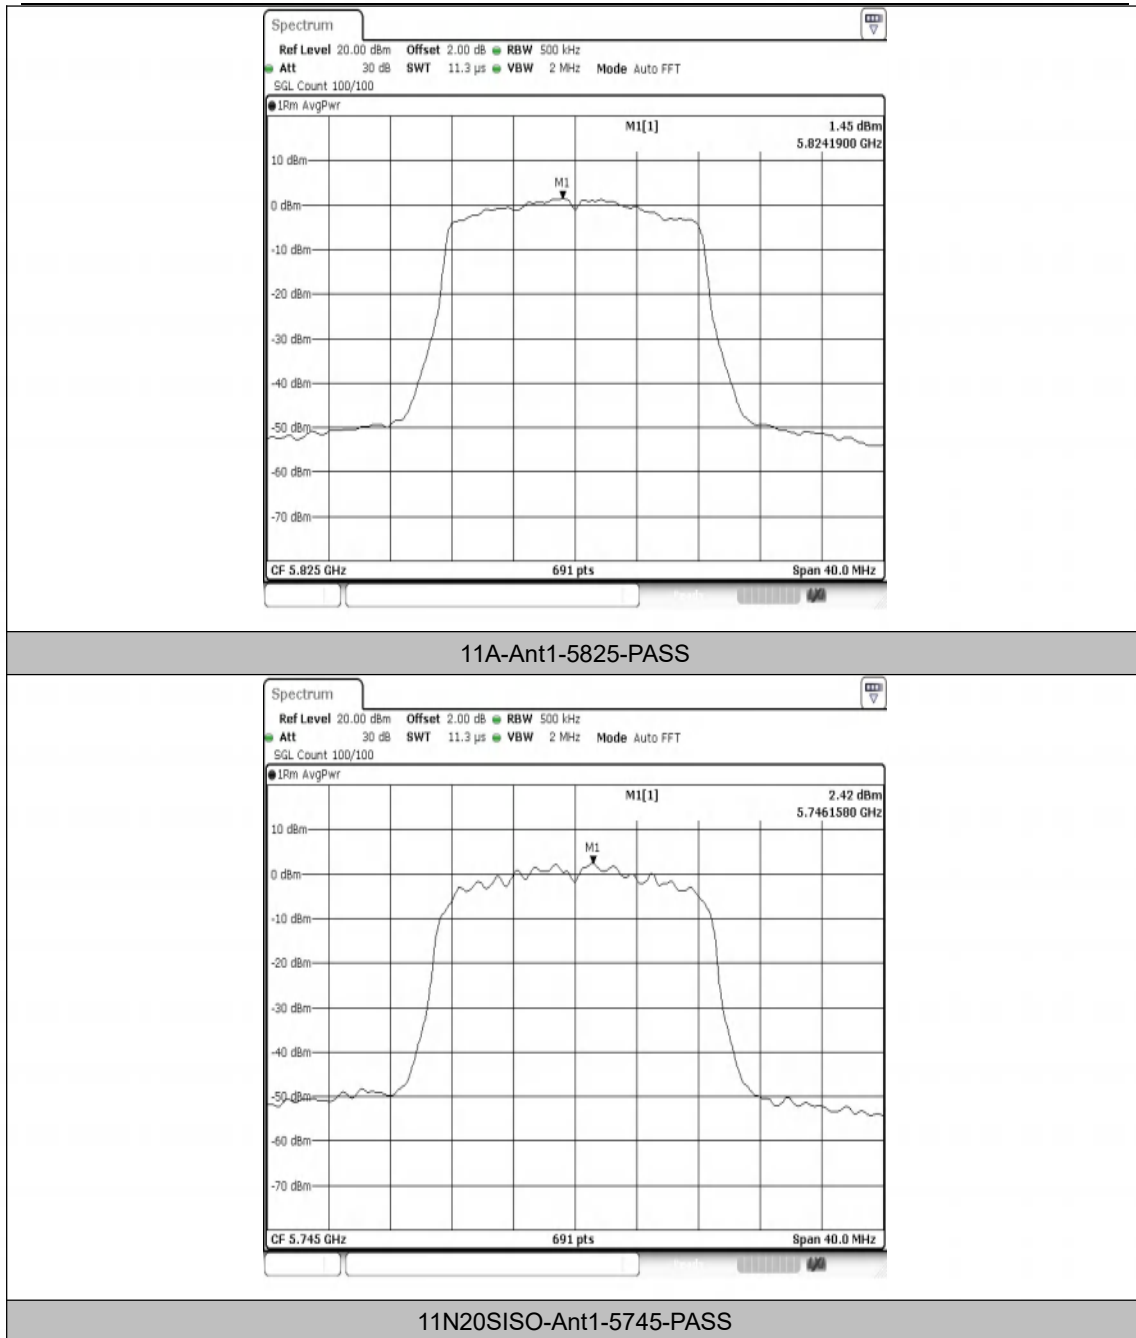

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

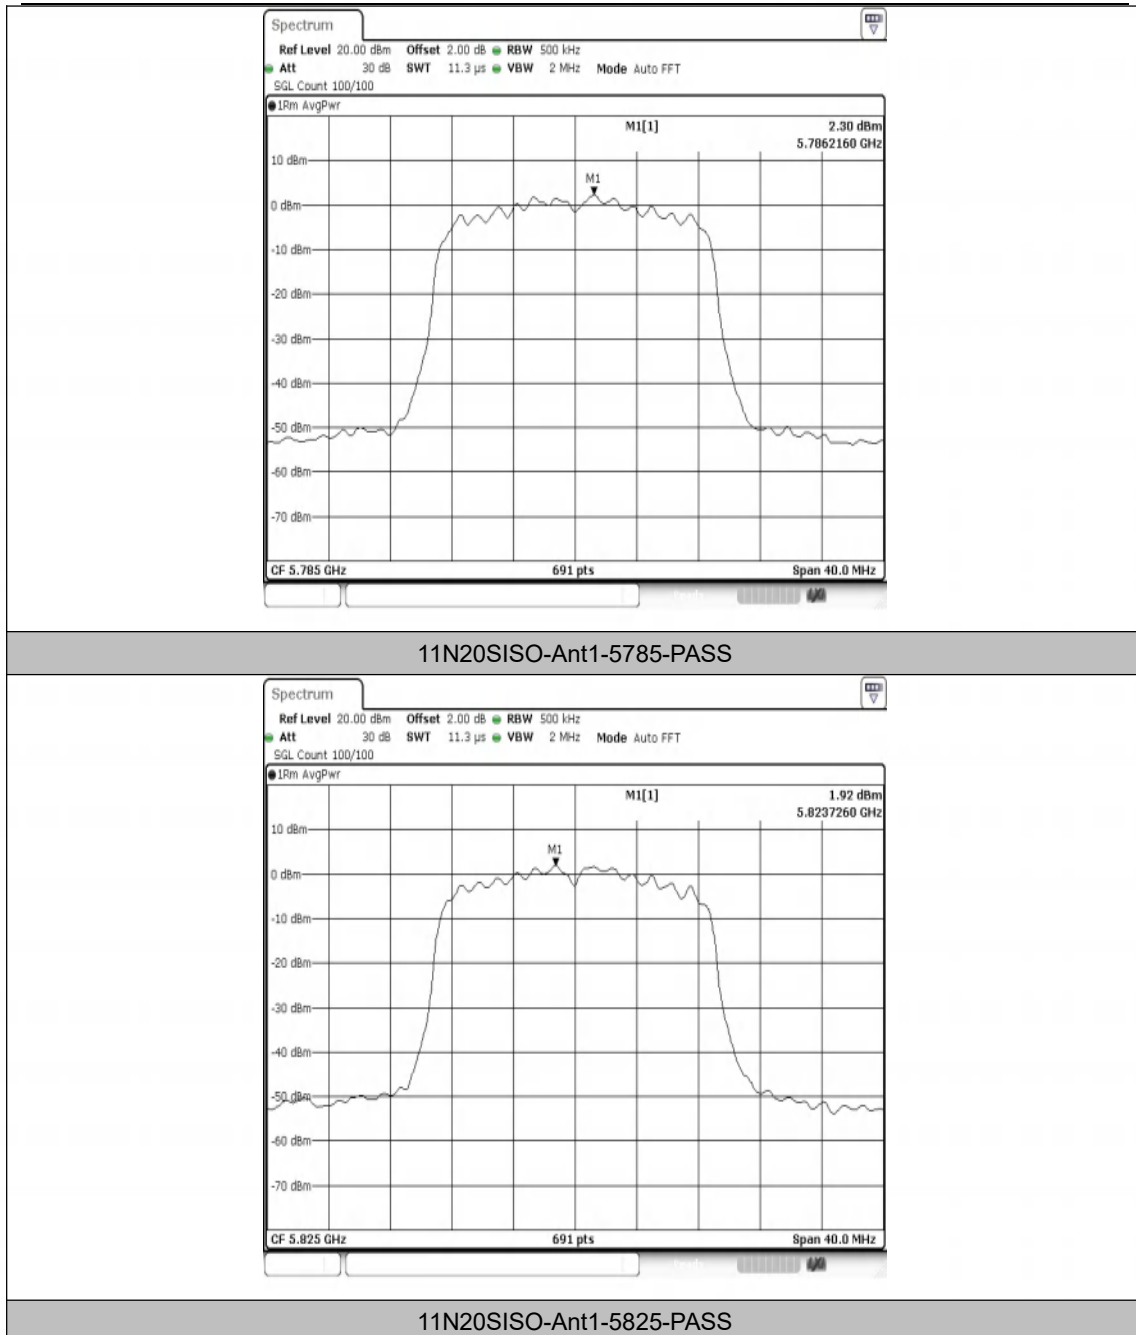

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

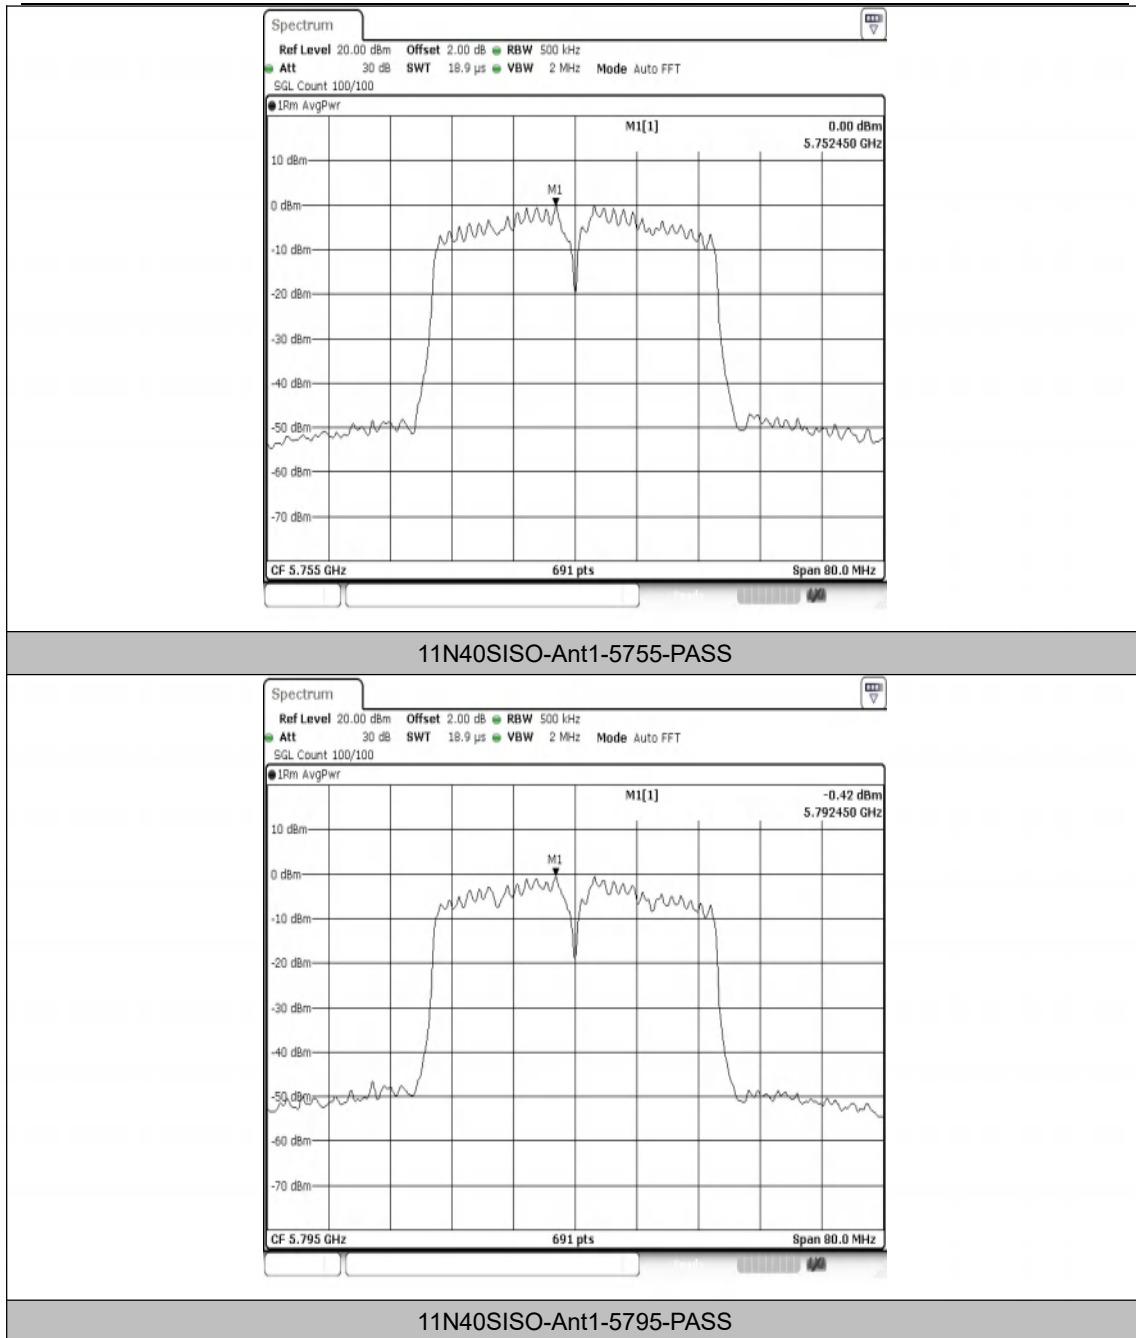


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

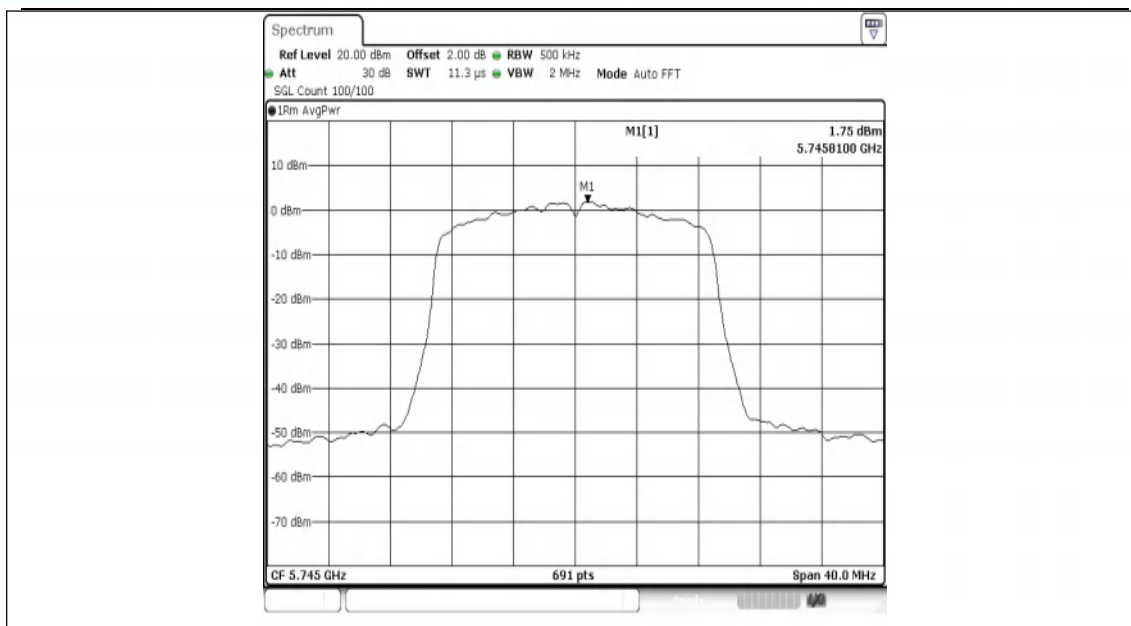


11AC20SISO-Ant1-5745-PASS

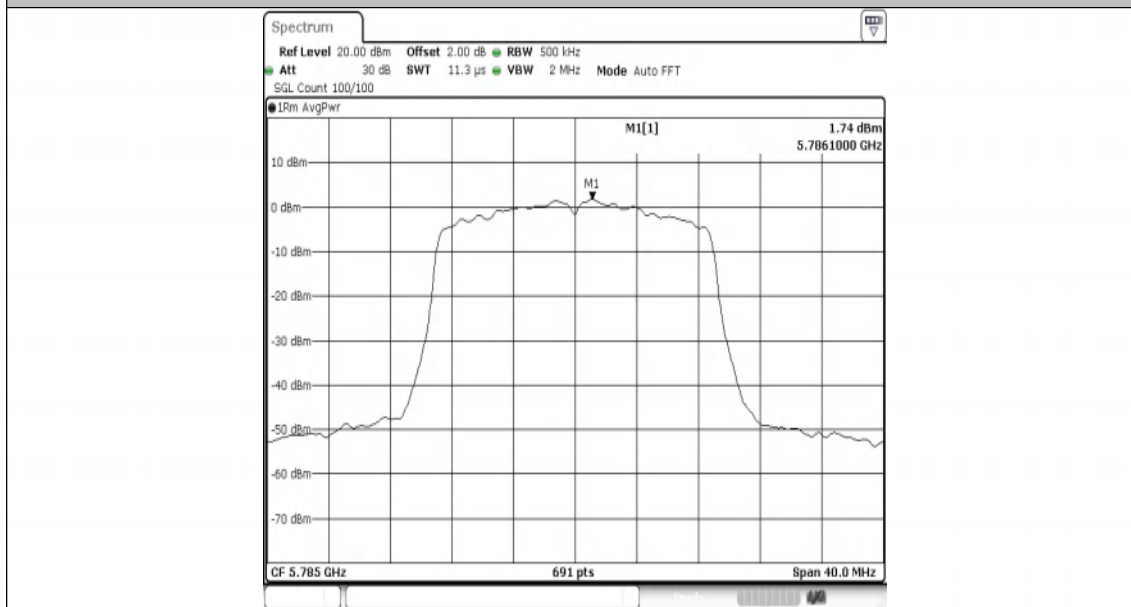


11AC20SISO-Ant1-5785-PASS

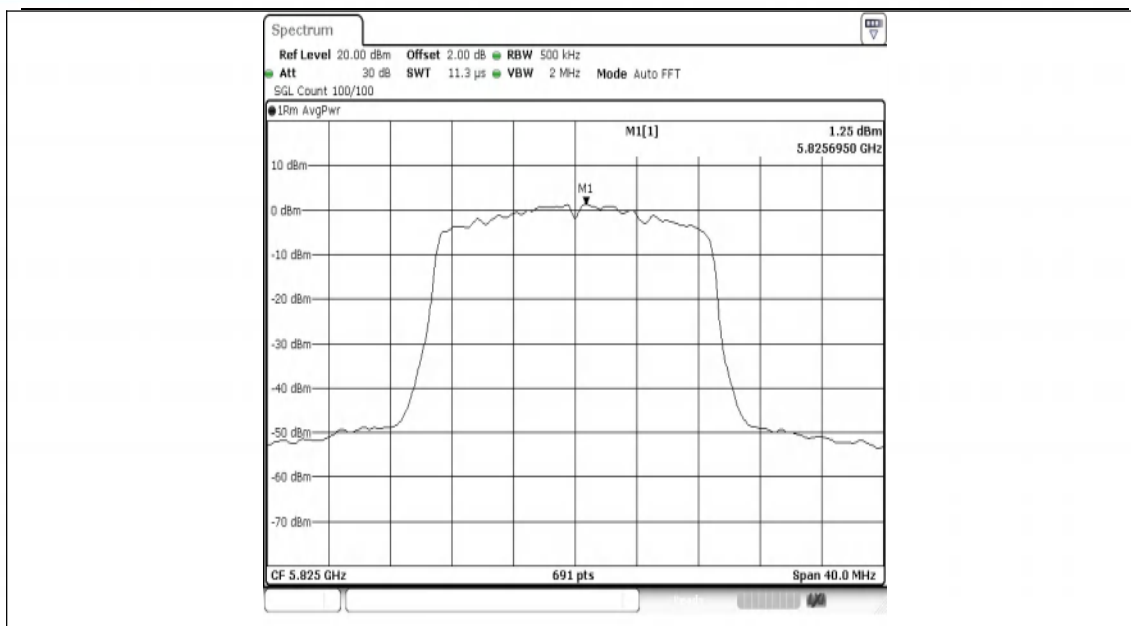


11AC20SISO-Ant1-5825-PASS

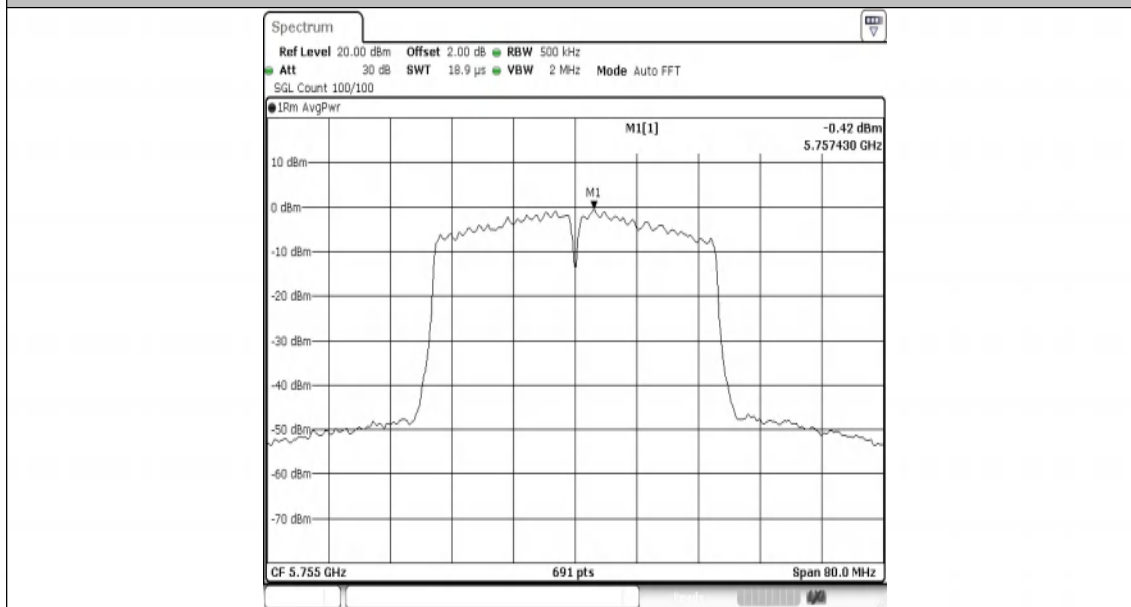


11AC40SISO-Ant1-5755-PASS

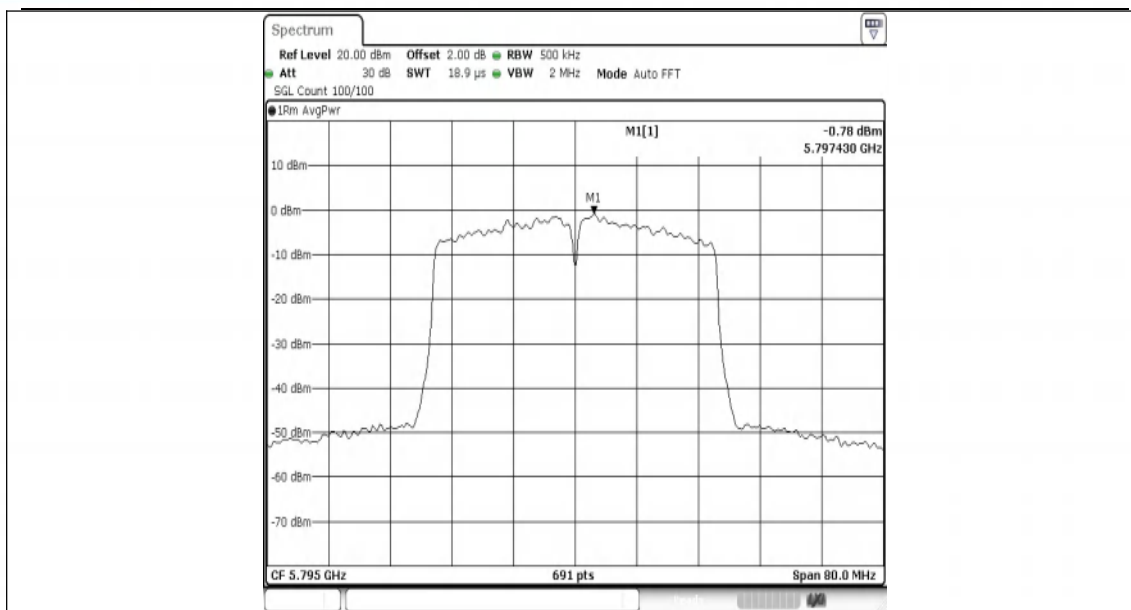

11AC40SISO-Ant1-5795-PASS

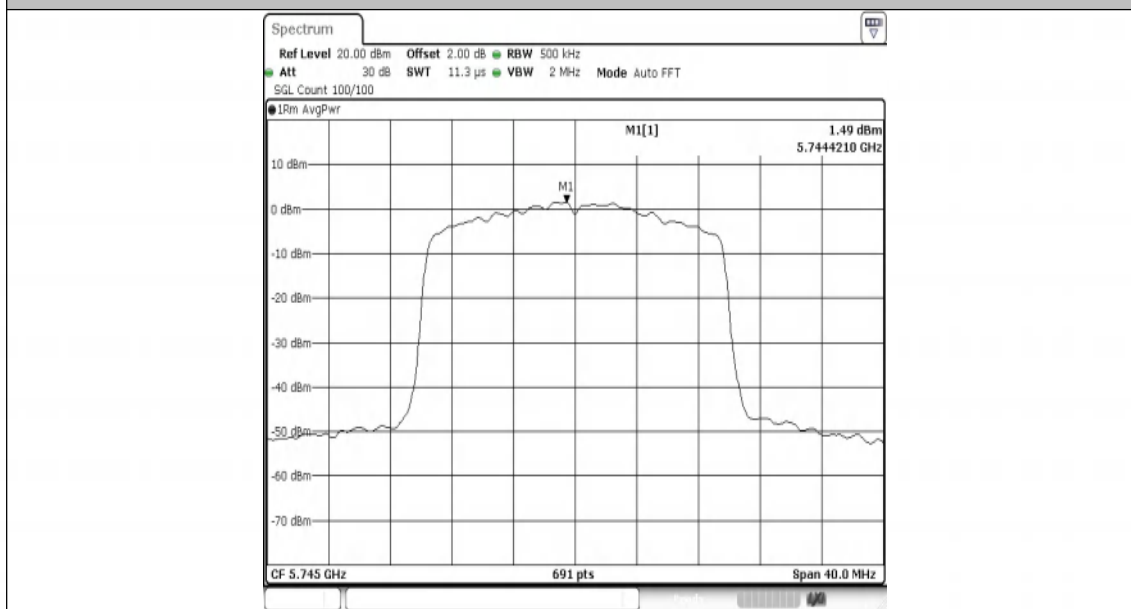


11AX20SISO-Ant1-5745-PASS

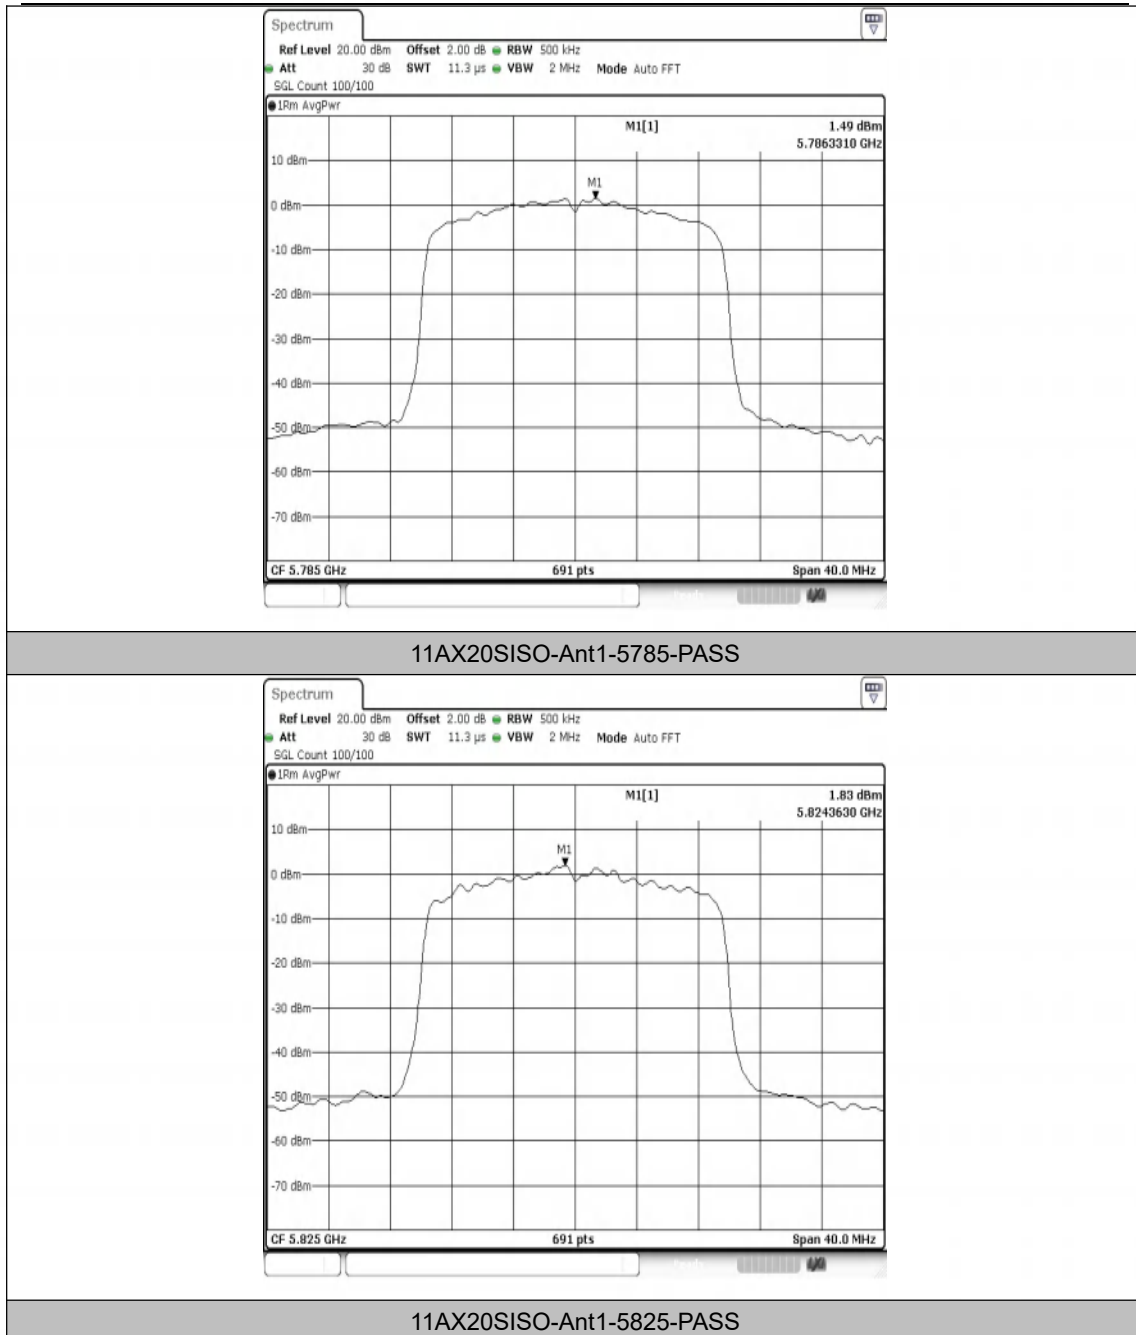


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

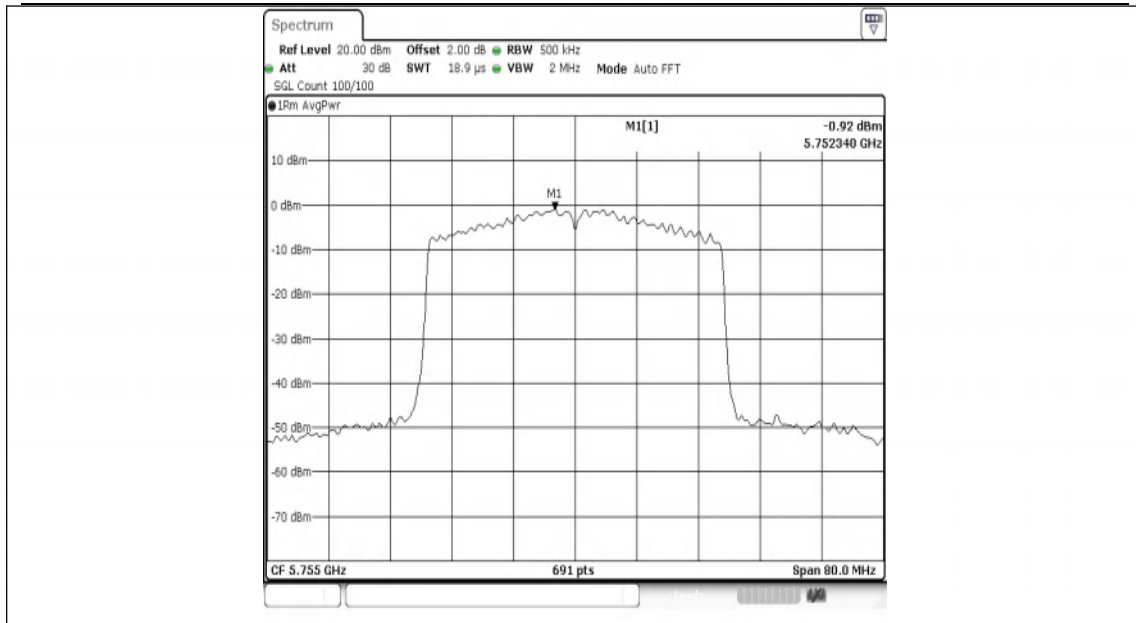

11AX40SISO-Ant1-5755-PASS

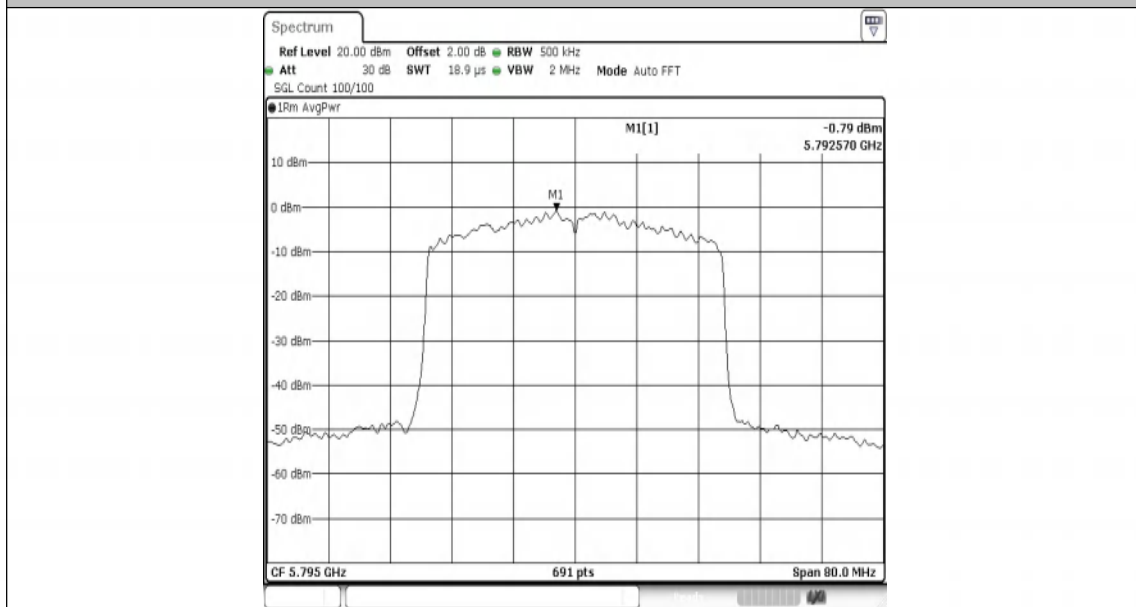

11AX40SISO-Ant1-5795-PASS

Appendix E: Band edge measurements

Test Result B1

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-34.52	≤-27	PASS
11A	Ant1	High	5240	-41.84	≤-27	PASS
11N20SISO	Ant1	Low	5180	-34.22	≤-27	PASS
11N20SISO	Ant1	High	5240	-42.7	≤-27	PASS
11N40SISO	Ant1	Low	5190	-34.27	≤-27	PASS
11N40SISO	Ant1	High	5230	-42.76	≤-27	PASS
11AC20SISO	Ant1	Low	5180	-34.22	≤-27	PASS
11AC20SISO	Ant1	High	5240	-42.19	≤-27	PASS
11AC40SISO	Ant1	Low	5190	-34.01	≤-27	PASS
11AC40SISO	Ant1	High	5230	-42.48	≤-27	PASS
11AX20SISO	Ant1	Low	5180	-33.98	≤-27	PASS
11AX20SISO	Ant1	High	5240	-41.95	≤-27	PASS
11AX40SISO	Ant1	Low	5190	-34.4	≤-27	PASS
11AX40SISO	Ant1	High	5230	-42.08	≤-27	PASS

Note: 1.The Antenna gain and cable loss are compensated in the graph.


Test Result B4


Test Mode	Antenna	Ch. Name	Frequency[MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-39.48	≤16.36	PASS
11A	Ant1	Low	5745	5700~5720	-39.52	≤12.24	PASS
11A	Ant1	Low	5745	5650~5700	-44.75	≤-26.88	PASS
11A	Ant1	Low	5745	5645~5650	-43.37	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-41.4	≤15.65	PASS
11A	Ant1	High	5825	5855~5875	-41.5	≤10.18	PASS
11A	Ant1	High	5825	5875~5925	-42.09	≤-26.87	PASS
11A	Ant1	High	5825	5925~5935	-42.46	≤-27	PASS
11N20SISO	Ant1	Low	5745	5720~5725	-34.72	≤15.98	PASS
11N20SISO	Ant1	Low	5745	5700~5720	-33.67	≤15.04	PASS
11N20SISO	Ant1	Low	5745	5650~5700	-44.4	≤-26.75	PASS
11N20SISO	Ant1	Low	5745	5645~5650	-43.9	≤-27	PASS
11N20SISO	Ant1	High	5825	5850~5855	-41.5	≤15.65	PASS
11N20SISO	Ant1	High	5825	5855~5875	-40.97	≤11.44	PASS
11N20SISO	Ant1	High	5825	5875~5925	-43.64	≤-26.87	PASS
11N20SISO	Ant1	High	5825	5925~5935	-42	≤-27	PASS
11N40SISO	Ant1	Low	5755	5720~5725	-32.54	≤15.90	PASS
11N40SISO	Ant1	Low	5755	5700~5720	-31.27	≤15.53	PASS
11N40SISO	Ant1	Low	5755	5650~5700	-43.44	≤-26.21	PASS
11N40SISO	Ant1	Low	5755	5645~5650	-42.98	≤-27	PASS
11N40SISO	Ant1	High	5795	5850~5855	-41.96	≤15.85	PASS
11N40SISO	Ant1	High	5795	5855~5875	-40.59	≤11.14	PASS
11N40SISO	Ant1	High	5795	5875~5925	-42.59	≤-26.97	PASS
11N40SISO	Ant1	High	5795	5925~5935	-43.02	≤-27	PASS
11AC20SISO	Ant1	Low	5745	5720~5725	-39.87	≤15.98	PASS
11AC20SISO	Ant1	Low	5745	5700~5720	-40.72	≤10.09	PASS
11AC20SISO	Ant1	Low	5745	5650~5700	-43.02	≤-26.88	PASS
11AC20SISO	Ant1	Low	5745	5645~5650	-42.95	≤-27	PASS
11AC20SISO	Ant1	High	5825	5850~5855	-40.23	≤15.65	PASS
11AC20SISO	Ant1	High	5825	5855~5875	-39.82	≤12.26	PASS
11AC20SISO	Ant1	High	5825	5875~5925	-44.31	≤-26.87	PASS
11AC20SISO	Ant1	High	5825	5925~5935	-42.39	≤-27	PASS
11AC40SISO	Ant1	Low	5755	5720~5725	-34.33	≤15.90	PASS
11AC40SISO	Ant1	Low	5755	5700~5720	-33.4	≤15.31	PASS
11AC40SISO	Ant1	Low	5755	5650~5700	-43.15	≤-26.50	PASS
11AC40SISO	Ant1	Low	5755	5645~5650	-42.47	≤-27	PASS
11AC40SISO	Ant1	High	5795	5850~5855	-41.01	≤15.85	PASS
11AC40SISO	Ant1	High	5795	5855~5875	-39.91	≤11.28	PASS
11AC40SISO	Ant1	High	5795	5875~5925	-43.69	≤-26.79	PASS


11AC40SISO	Ant1	High	5795	5925~5935	-43.37	≤-27	PASS
11AX20SISO	Ant1	Low	5745	5720~5725	-32.77	≤15.98	PASS
11AX20SISO	Ant1	Low	5745	5700~5720	-32.17	≤15.37	PASS
11AX20SISO	Ant1	Low	5745	5650~5700	-42.81	≤-25.89	PASS
11AX20SISO	Ant1	Low	5745	5645~5650	-43.55	≤-27	PASS
11AX20SISO	Ant1	High	5825	5850~5855	-34.27	≤21.89	PASS
11AX20SISO	Ant1	High	5825	5855~5875	-40.57	≤10.13	PASS
11AX20SISO	Ant1	High	5825	5875~5925	-41.07	≤-26.44	PASS
11AX20SISO	Ant1	High	5825	5925~5935	-43.15	≤-27	PASS
11AX40SISO	Ant1	Low	5755	5720~5725	-32.48	≤16.34	PASS
11AX40SISO	Ant1	Low	5755	5700~5720	-33.66	≤14.98	PASS
11AX40SISO	Ant1	Low	5755	5650~5700	-43	≤-26.36	PASS
11AX40SISO	Ant1	Low	5755	5645~5650	-42.89	≤-27	PASS
11AX40SISO	Ant1	High	5795	5850~5855	-42.03	≤15.85	PASS
11AX40SISO	Ant1	High	5795	5855~5875	-40.72	≤10.61	PASS
11AX40SISO	Ant1	High	5795	5875~5925	-42.49	≤-26.44	PASS
11AX40SISO	Ant1	High	5795	5925~5935	-43.1	≤-27	PASS


Note: 1.The Antenna gain and cable loss are compensated in the graph.


Test Graphs B1

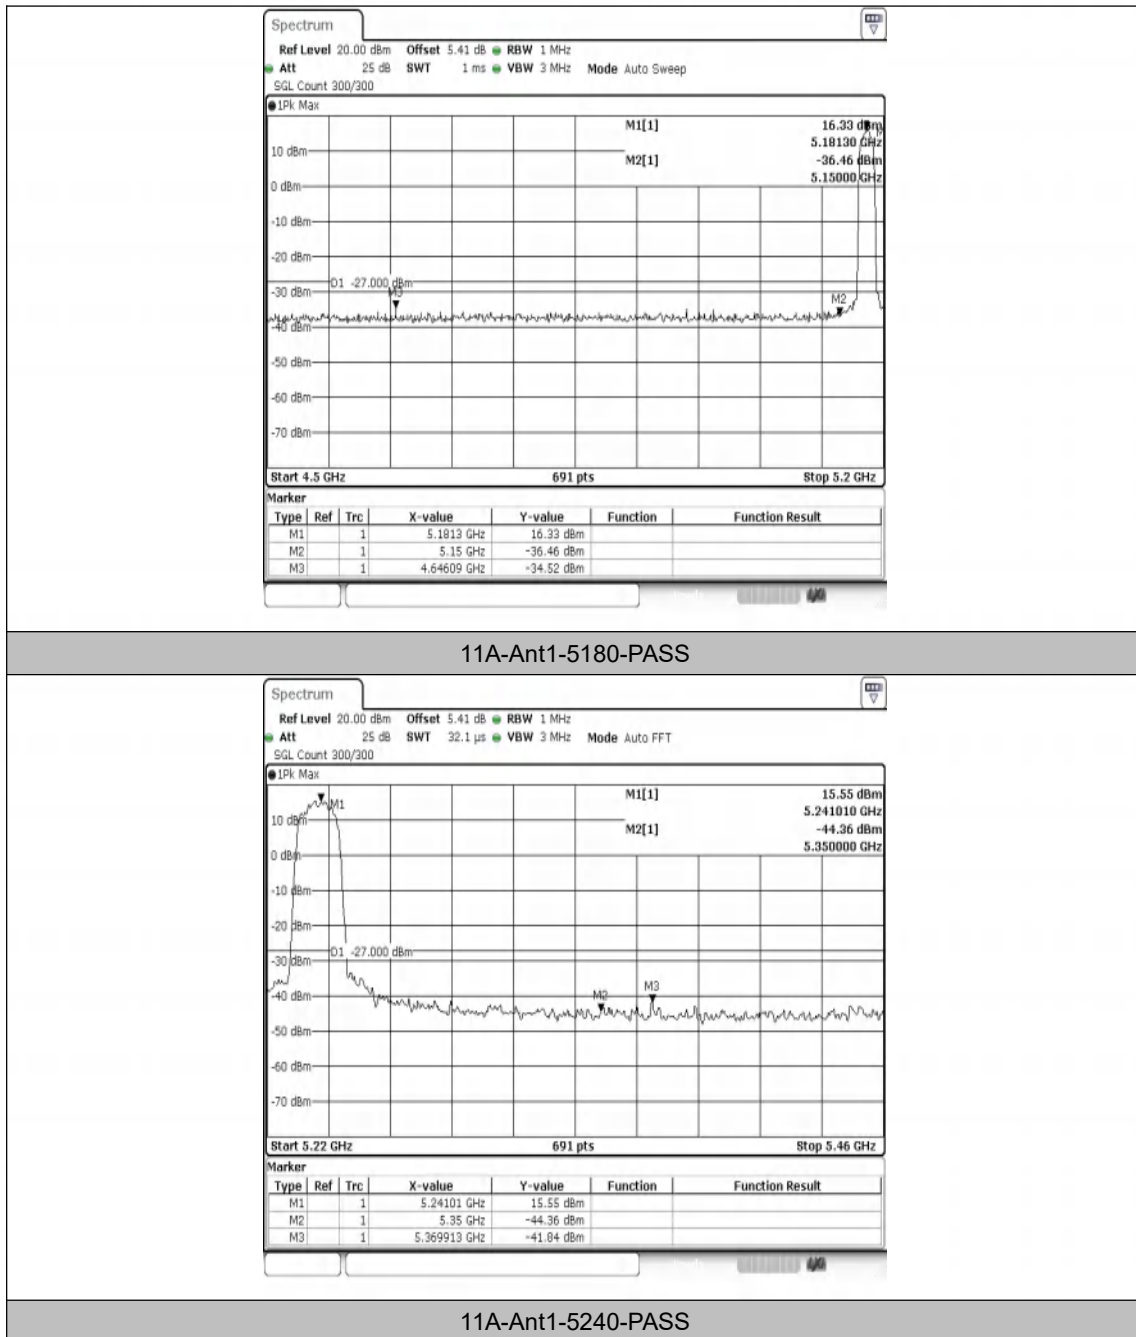


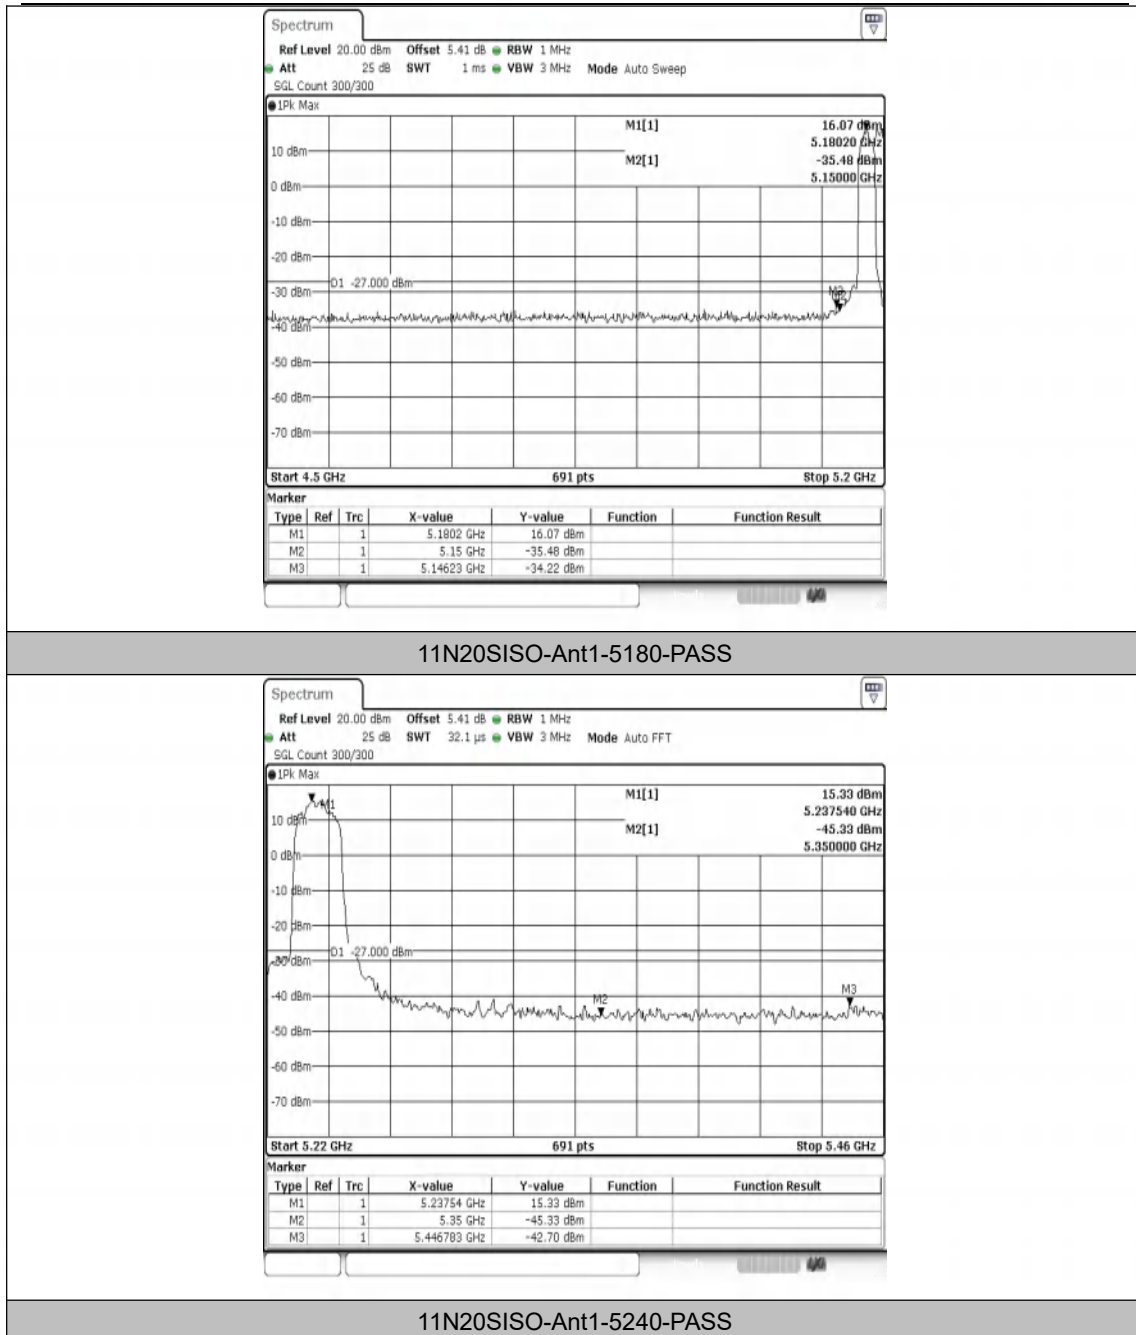


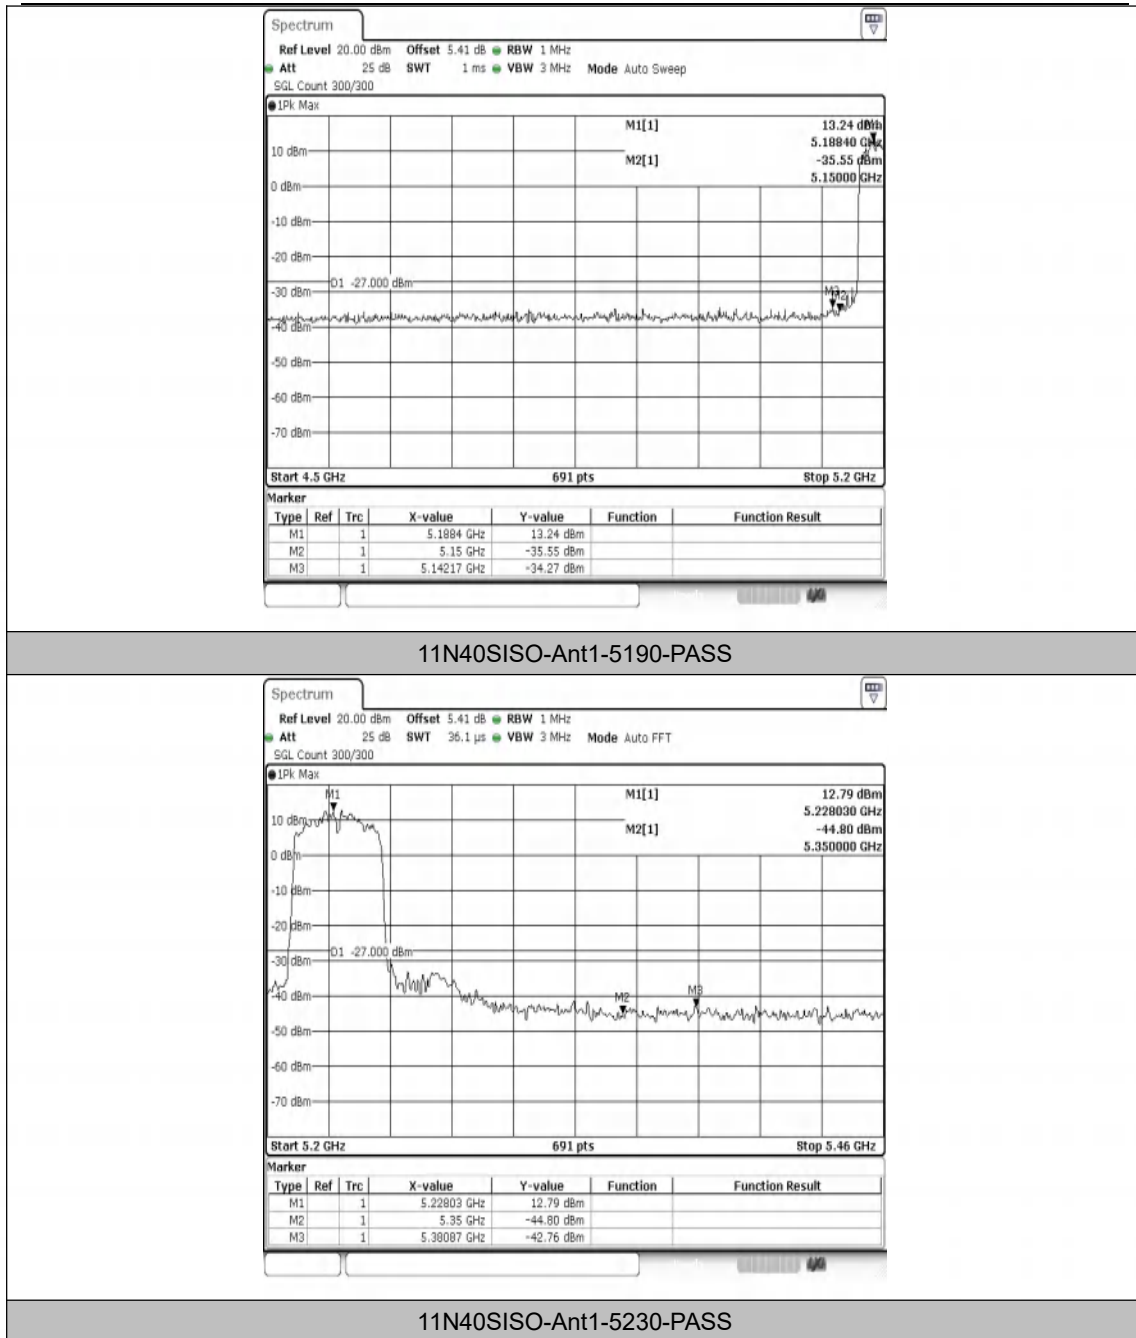

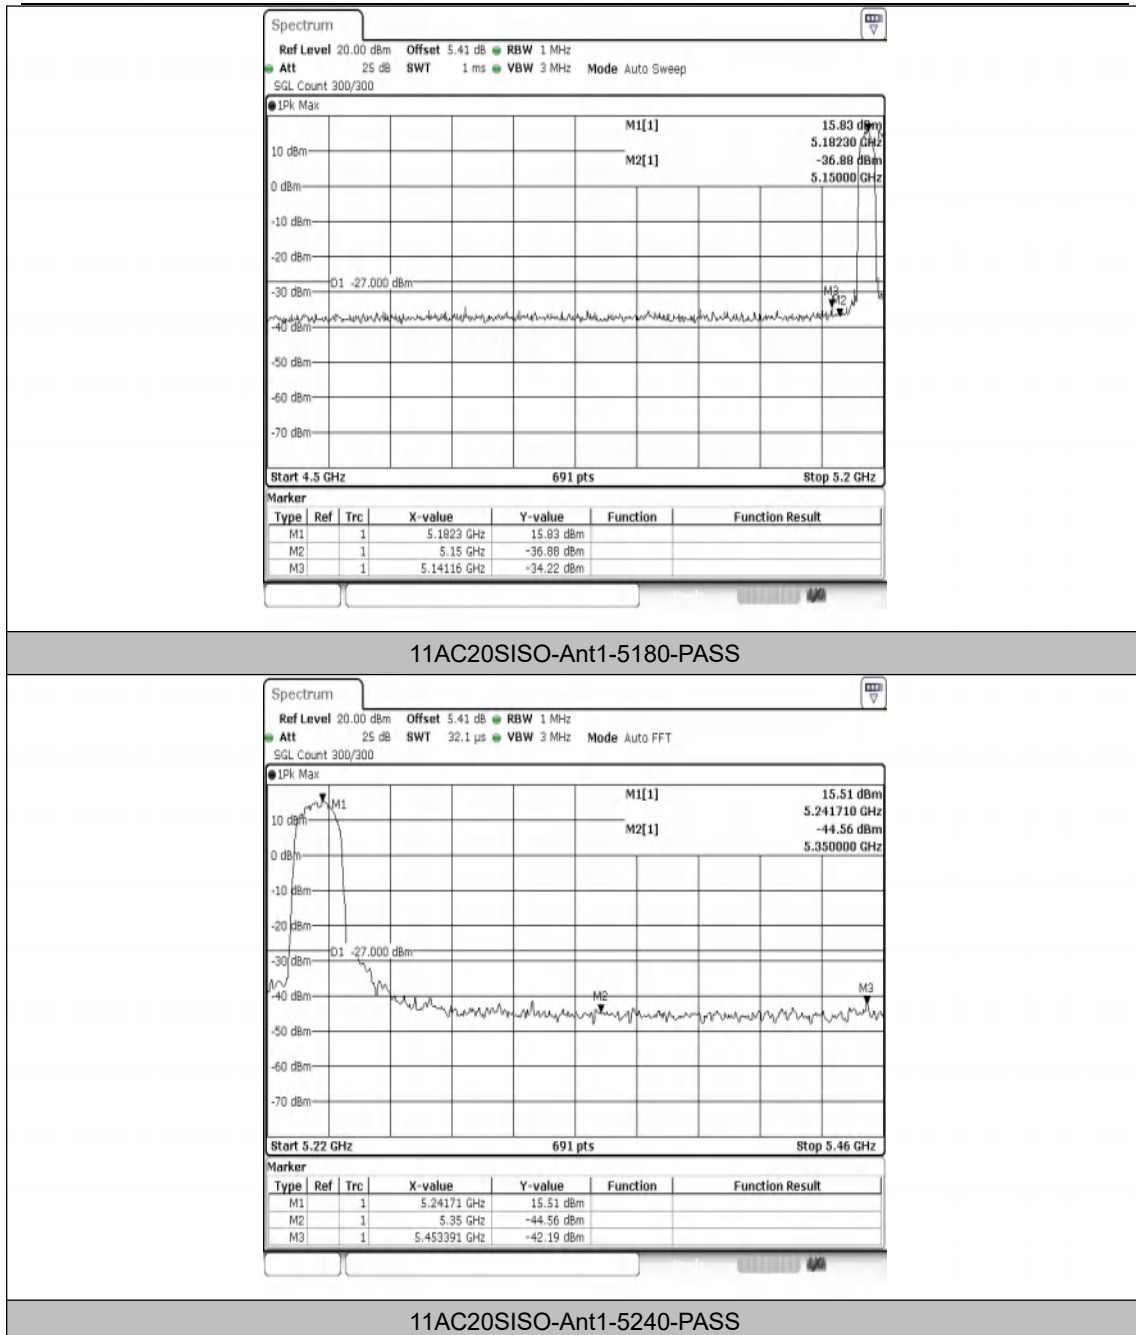

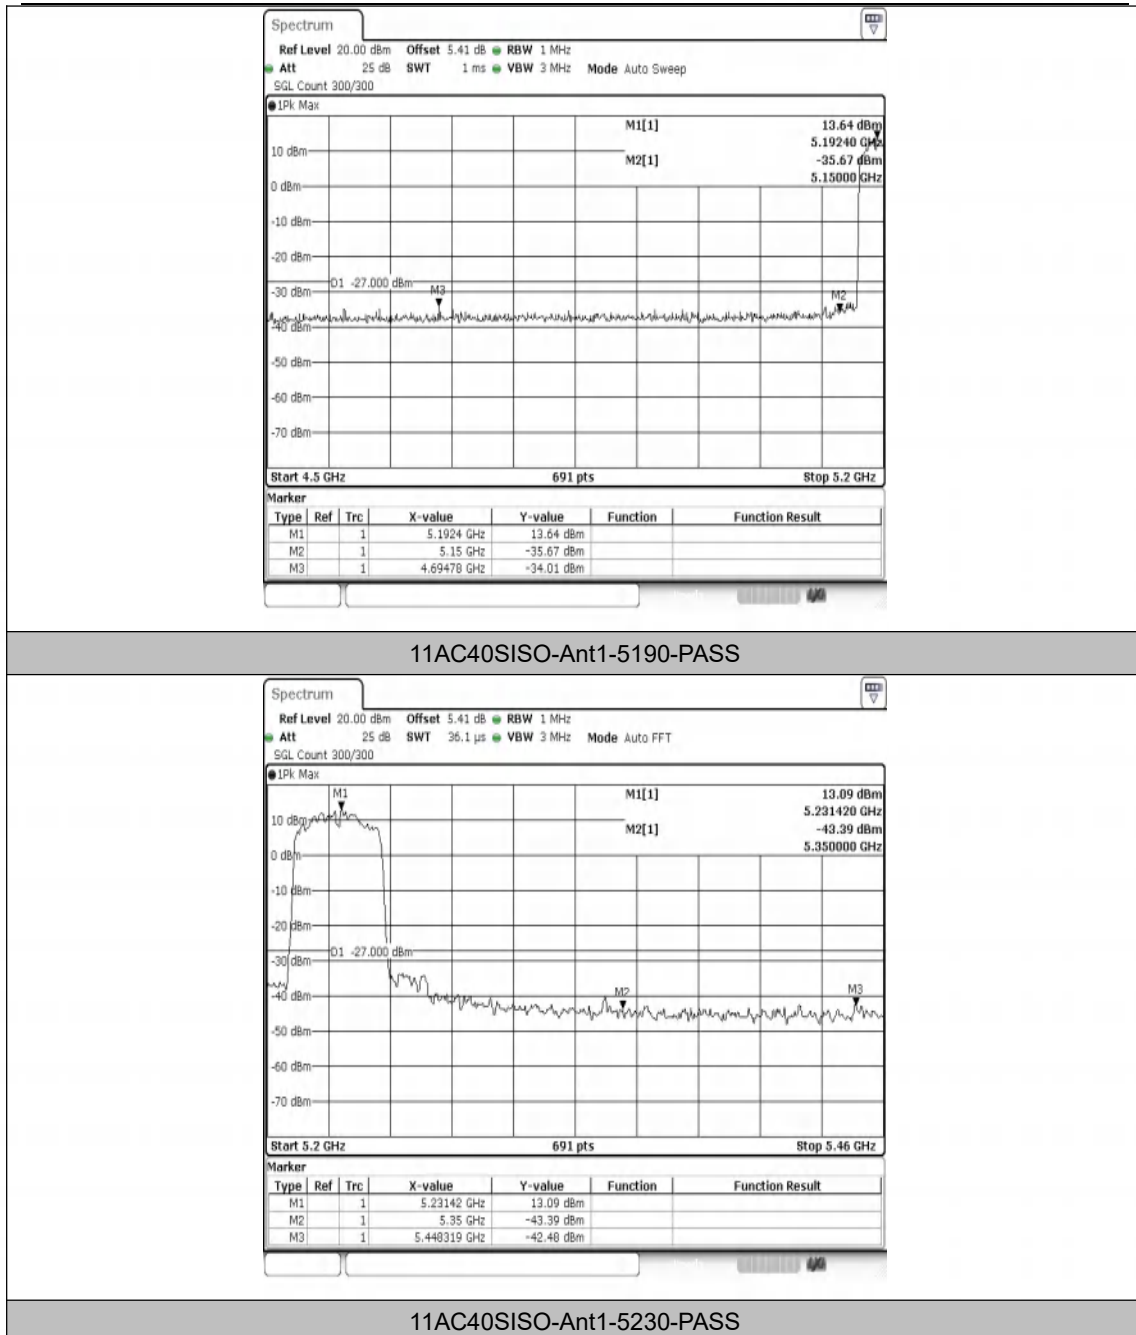

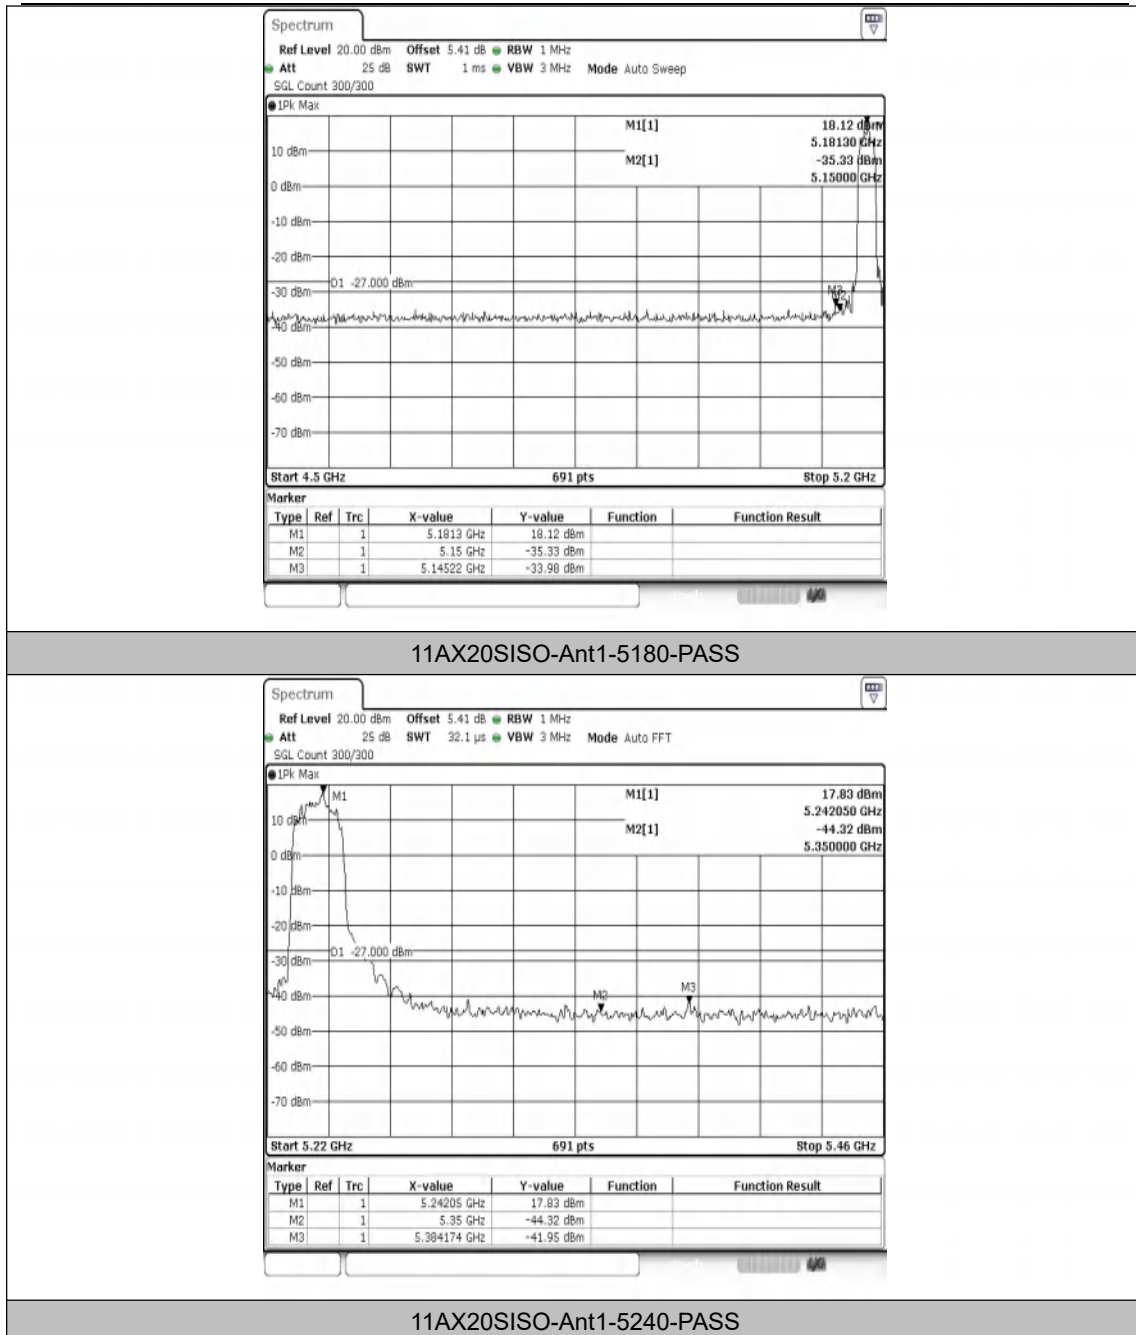

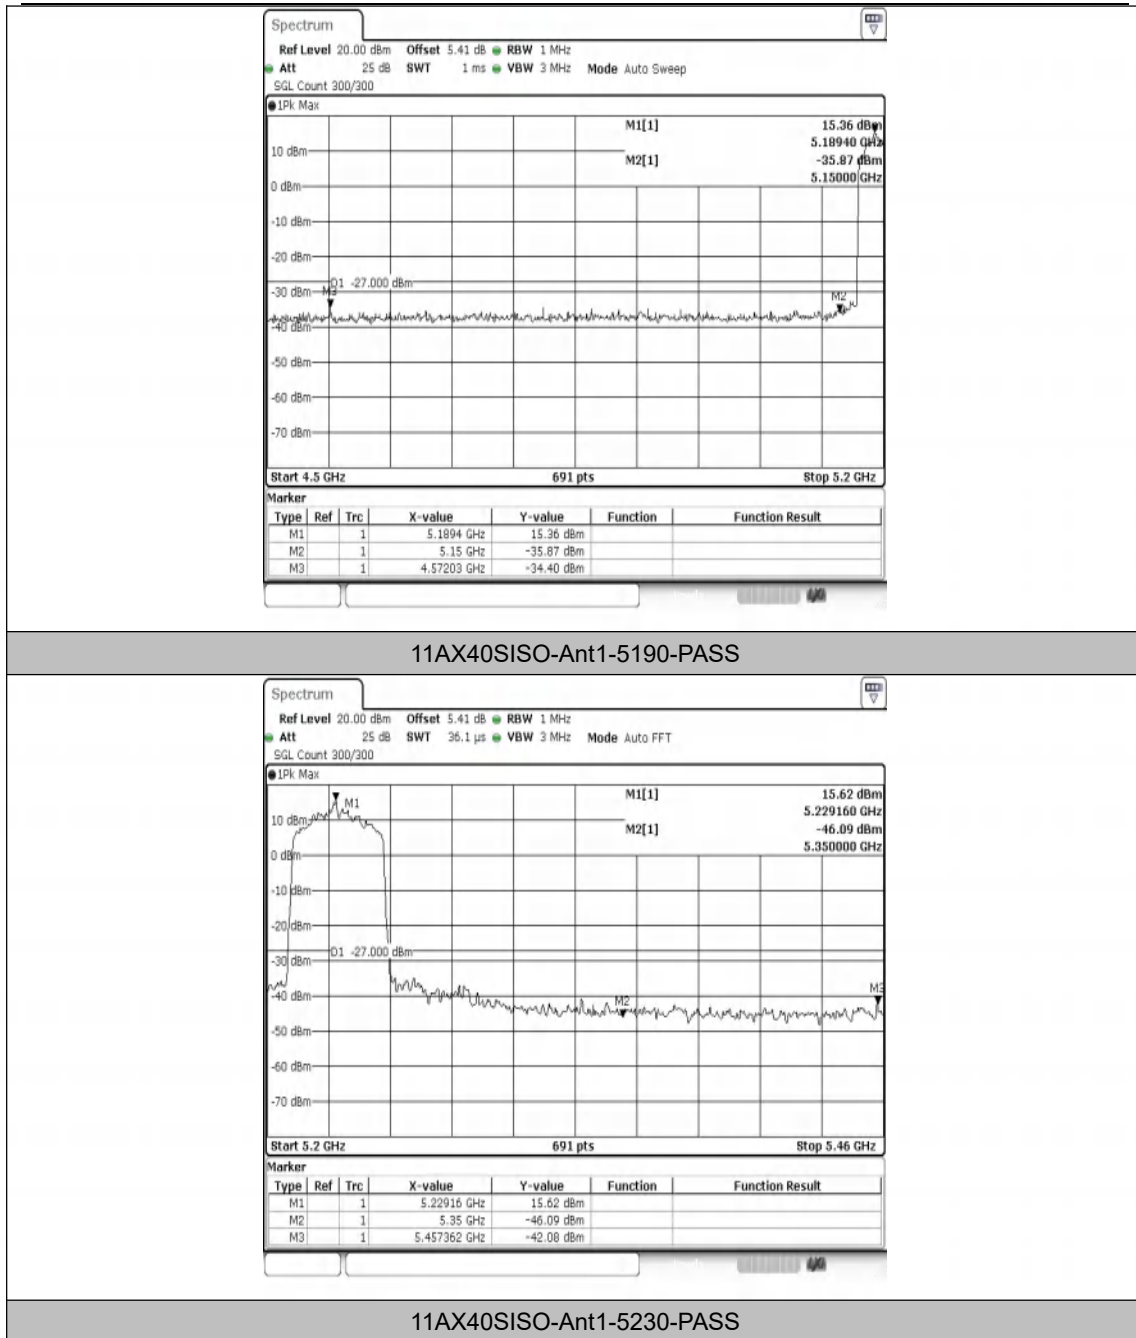



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs B4

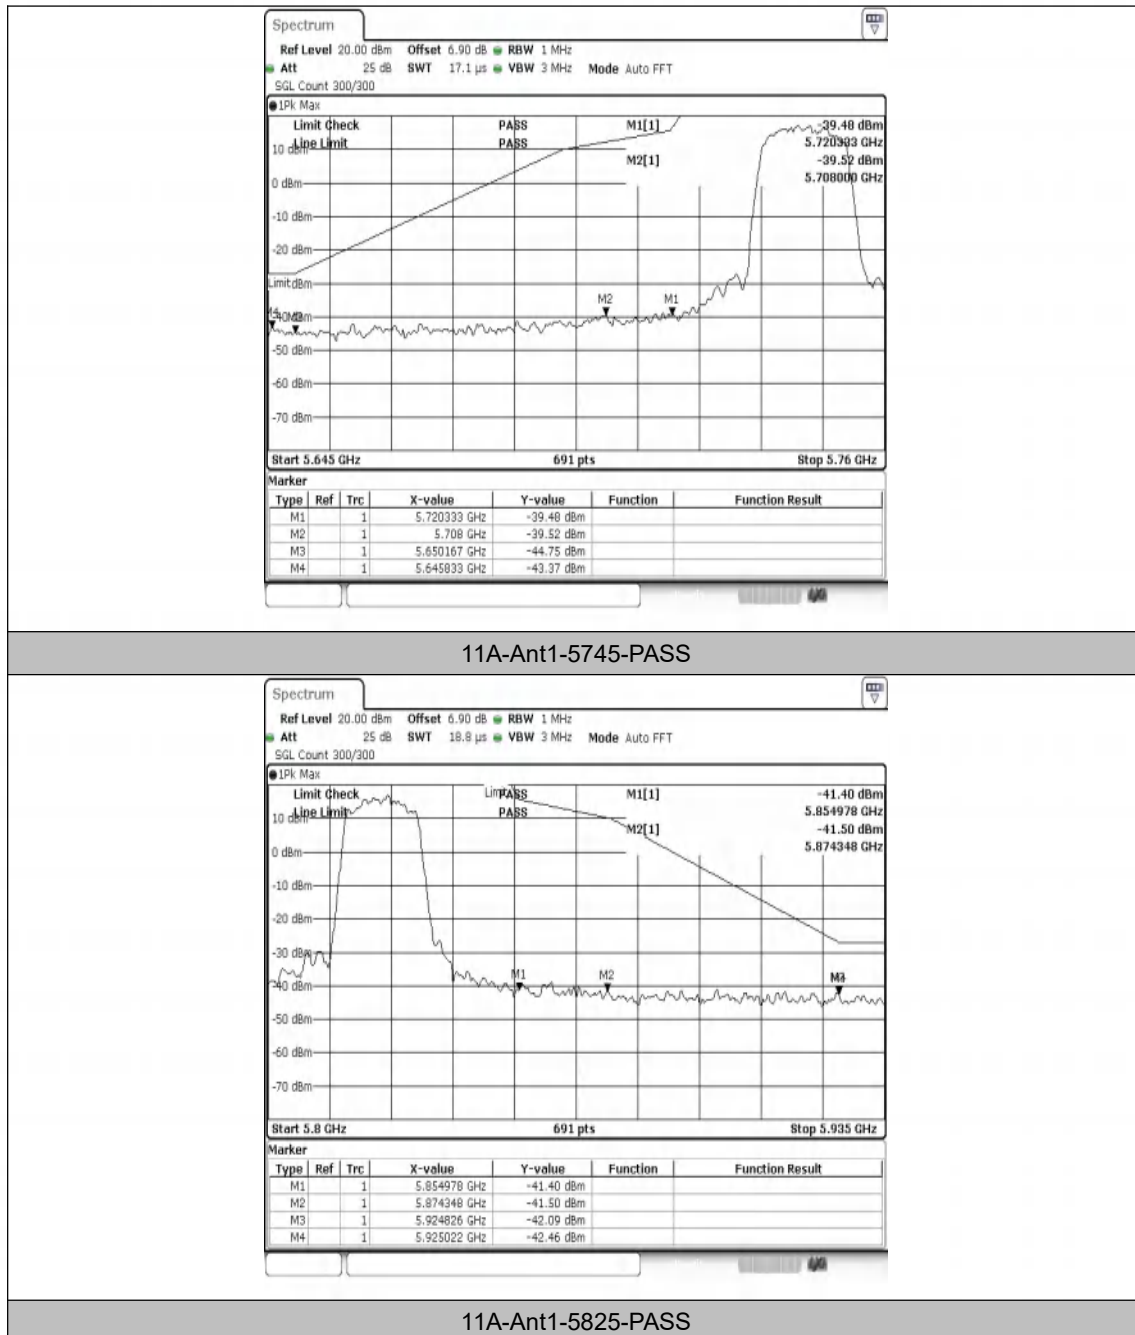


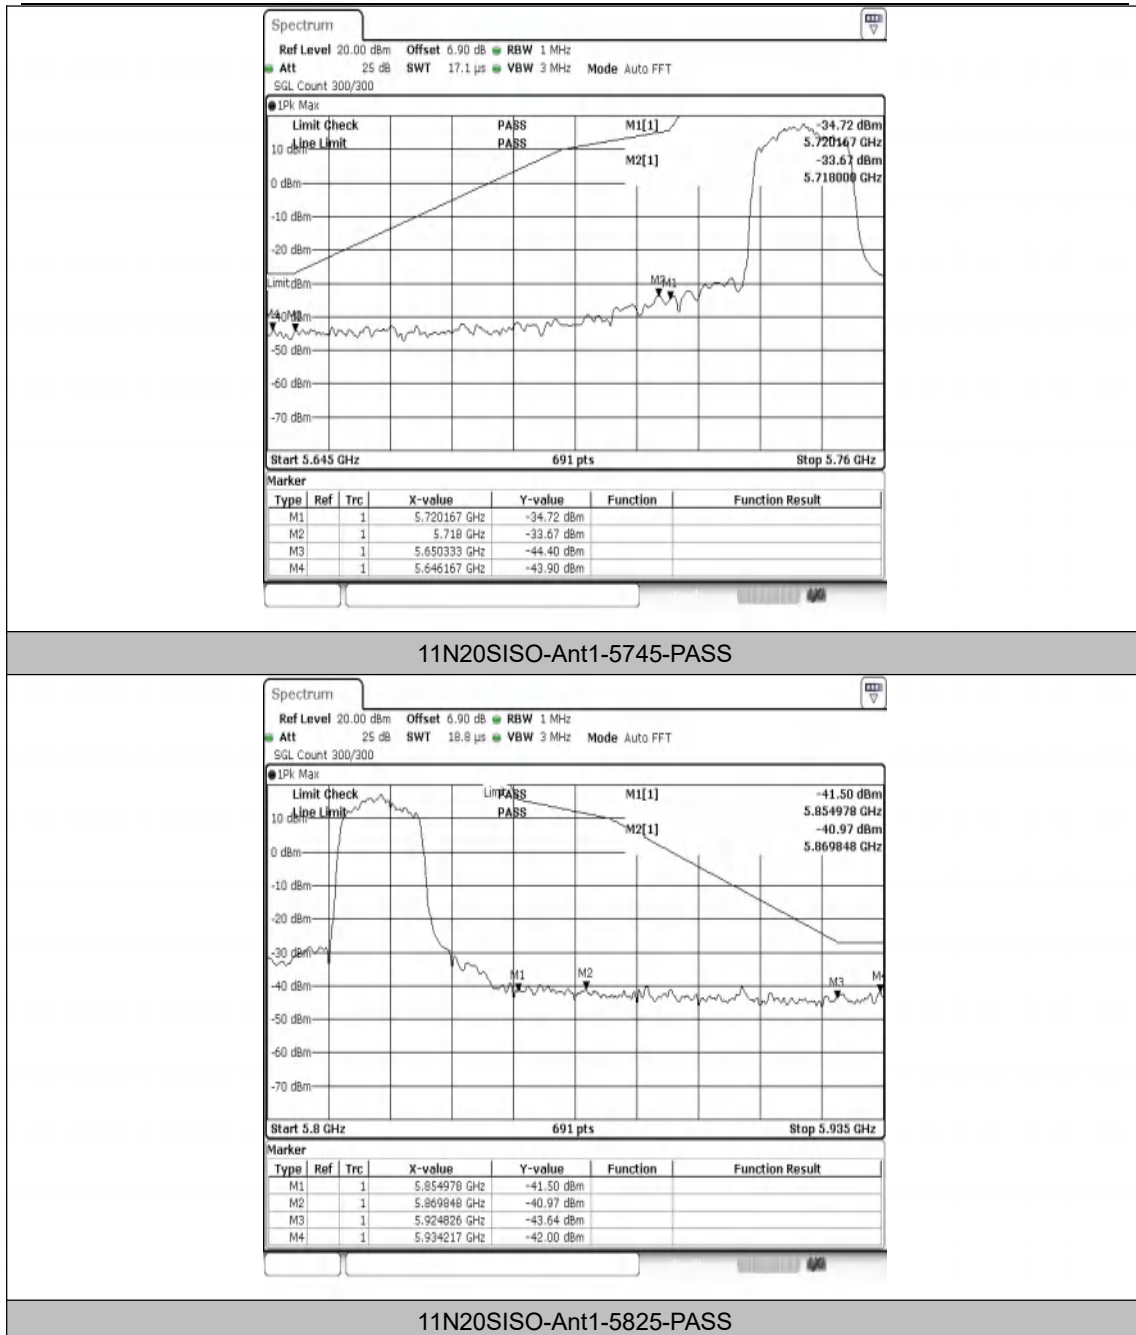


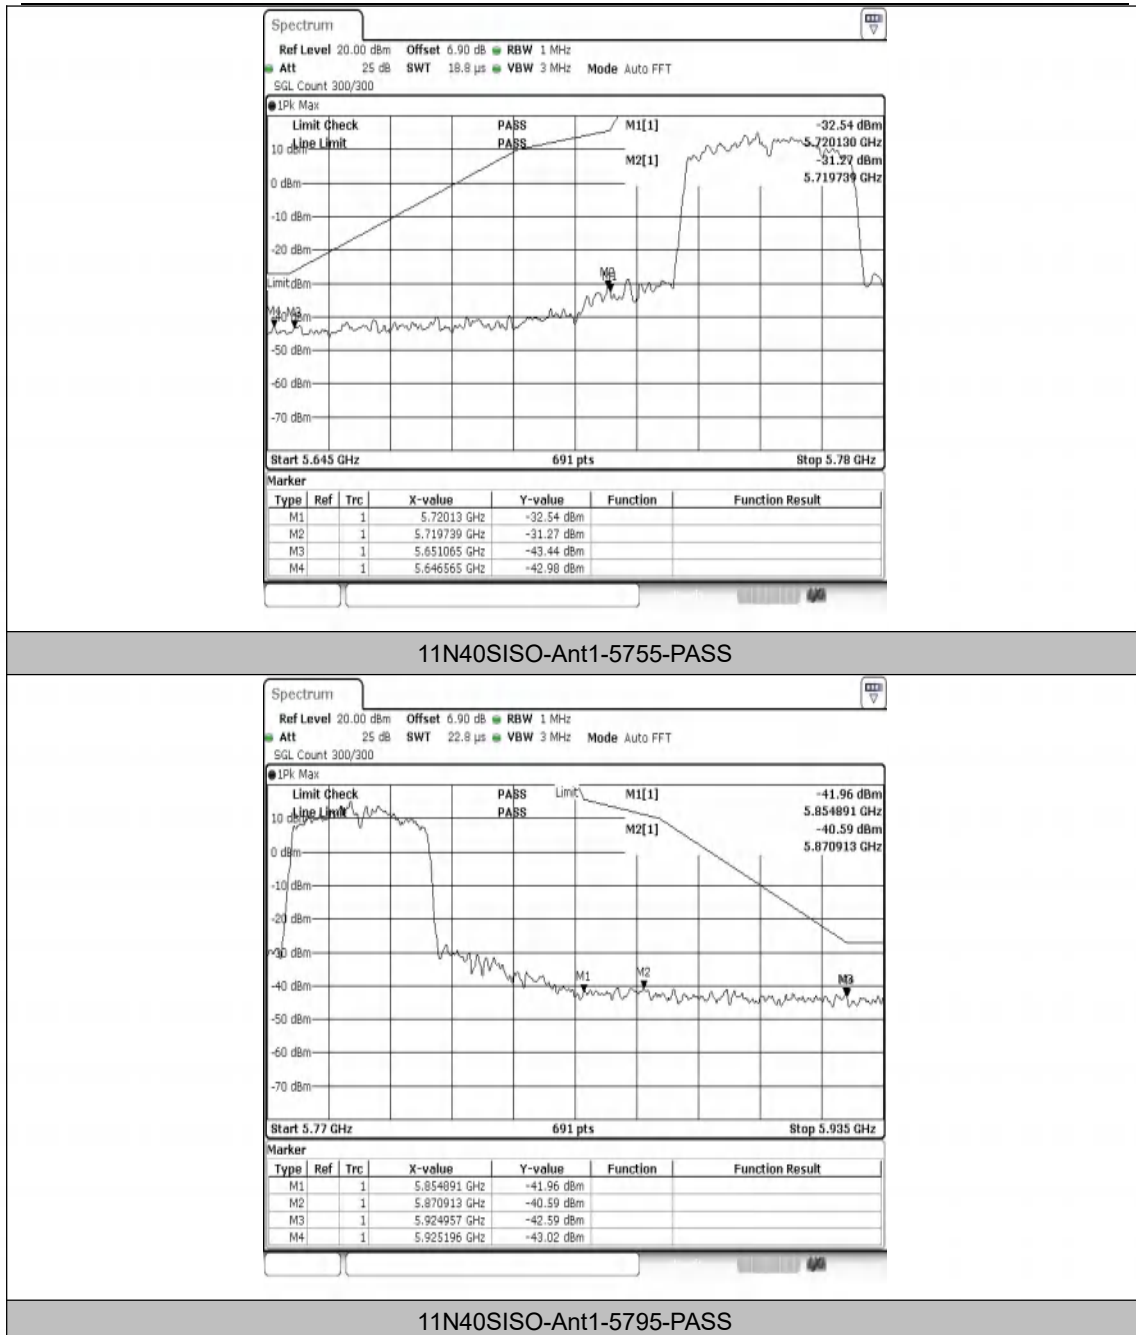

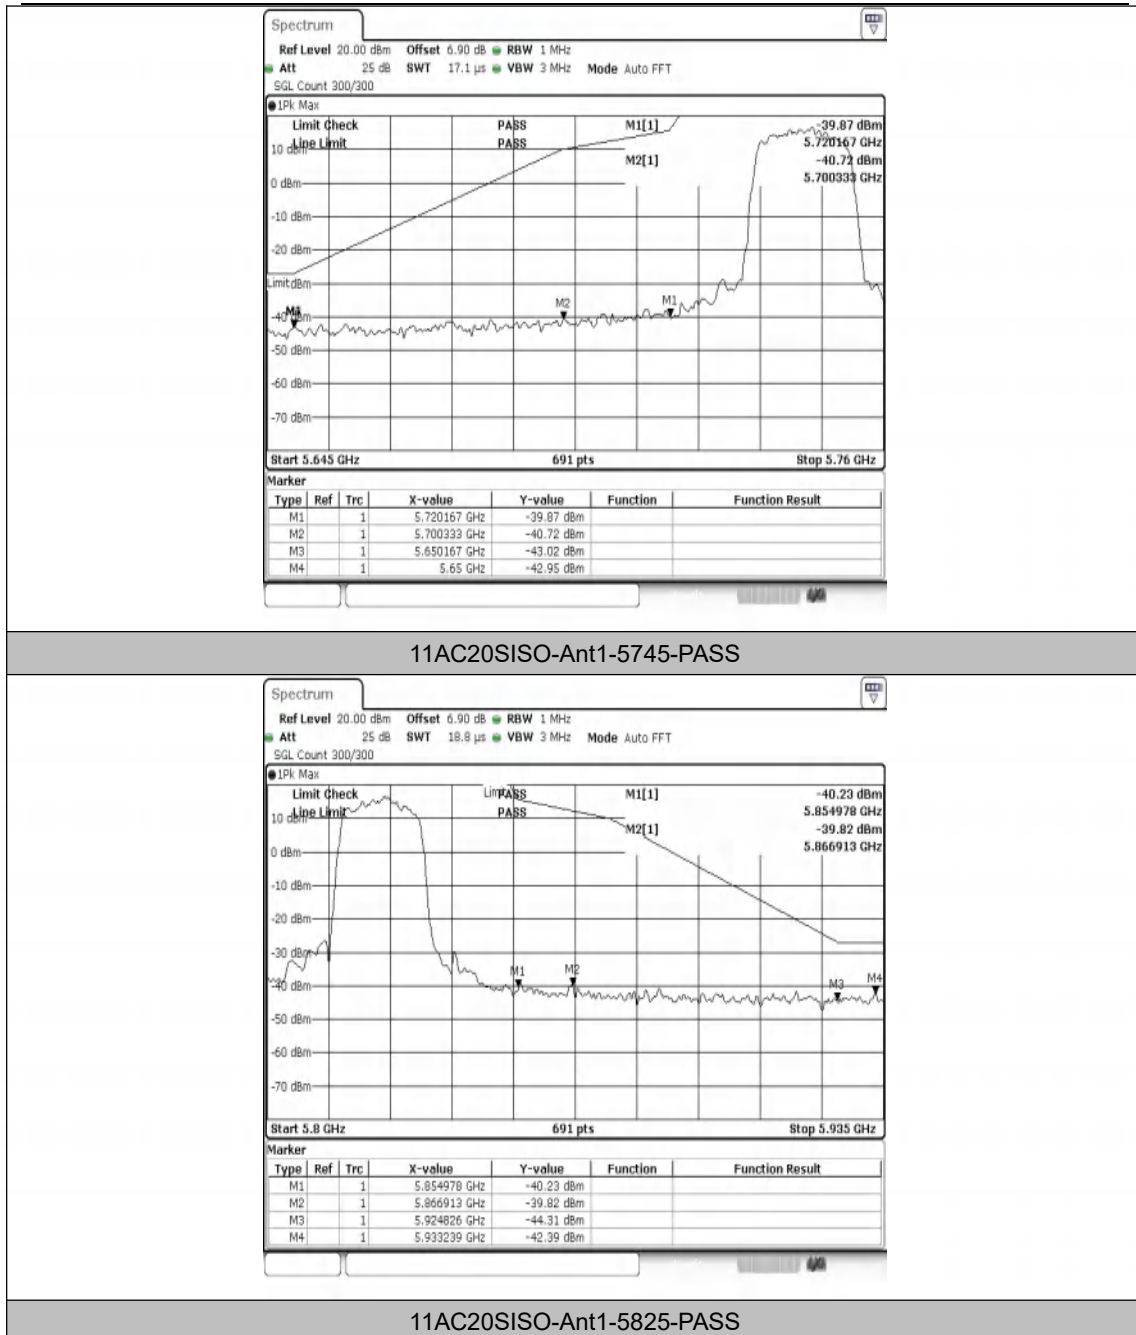

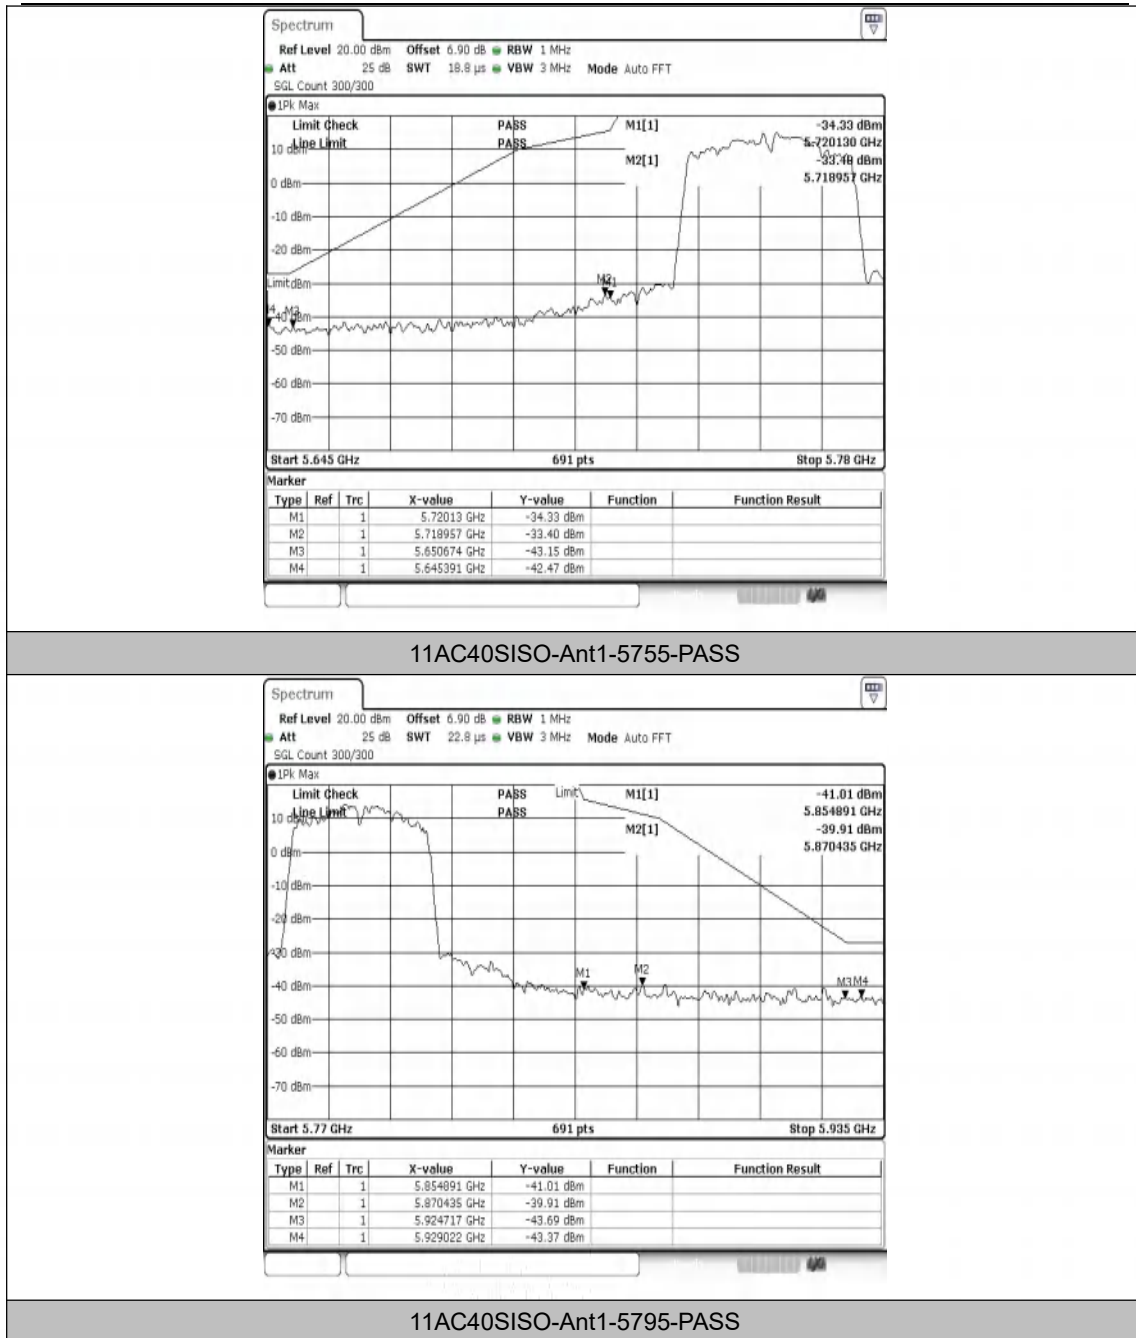

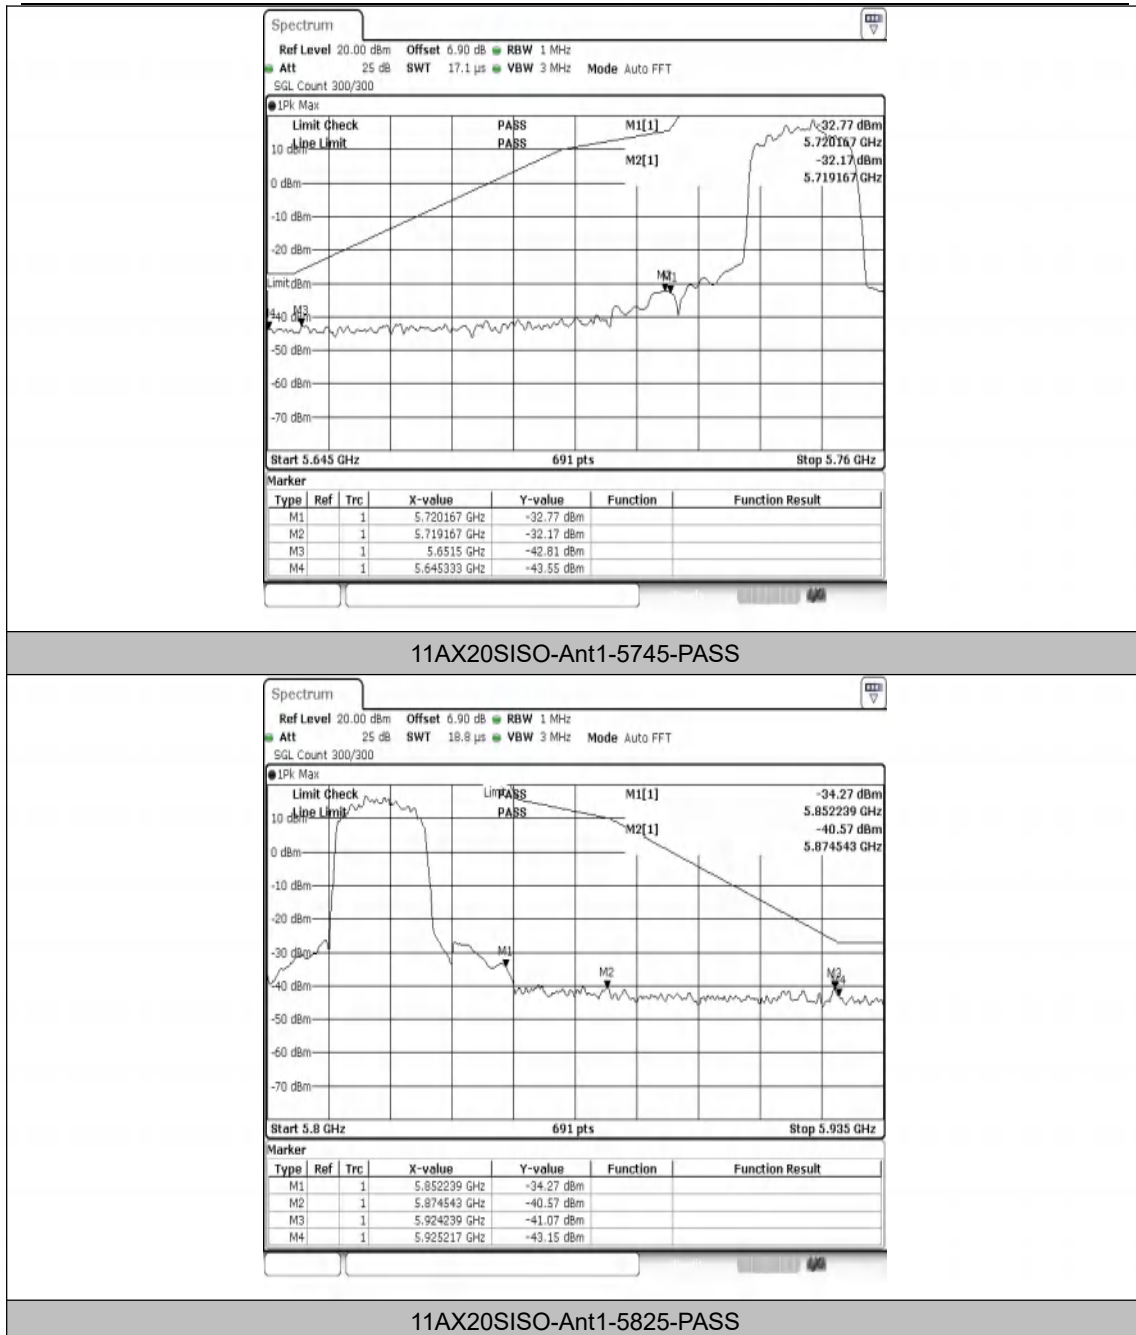

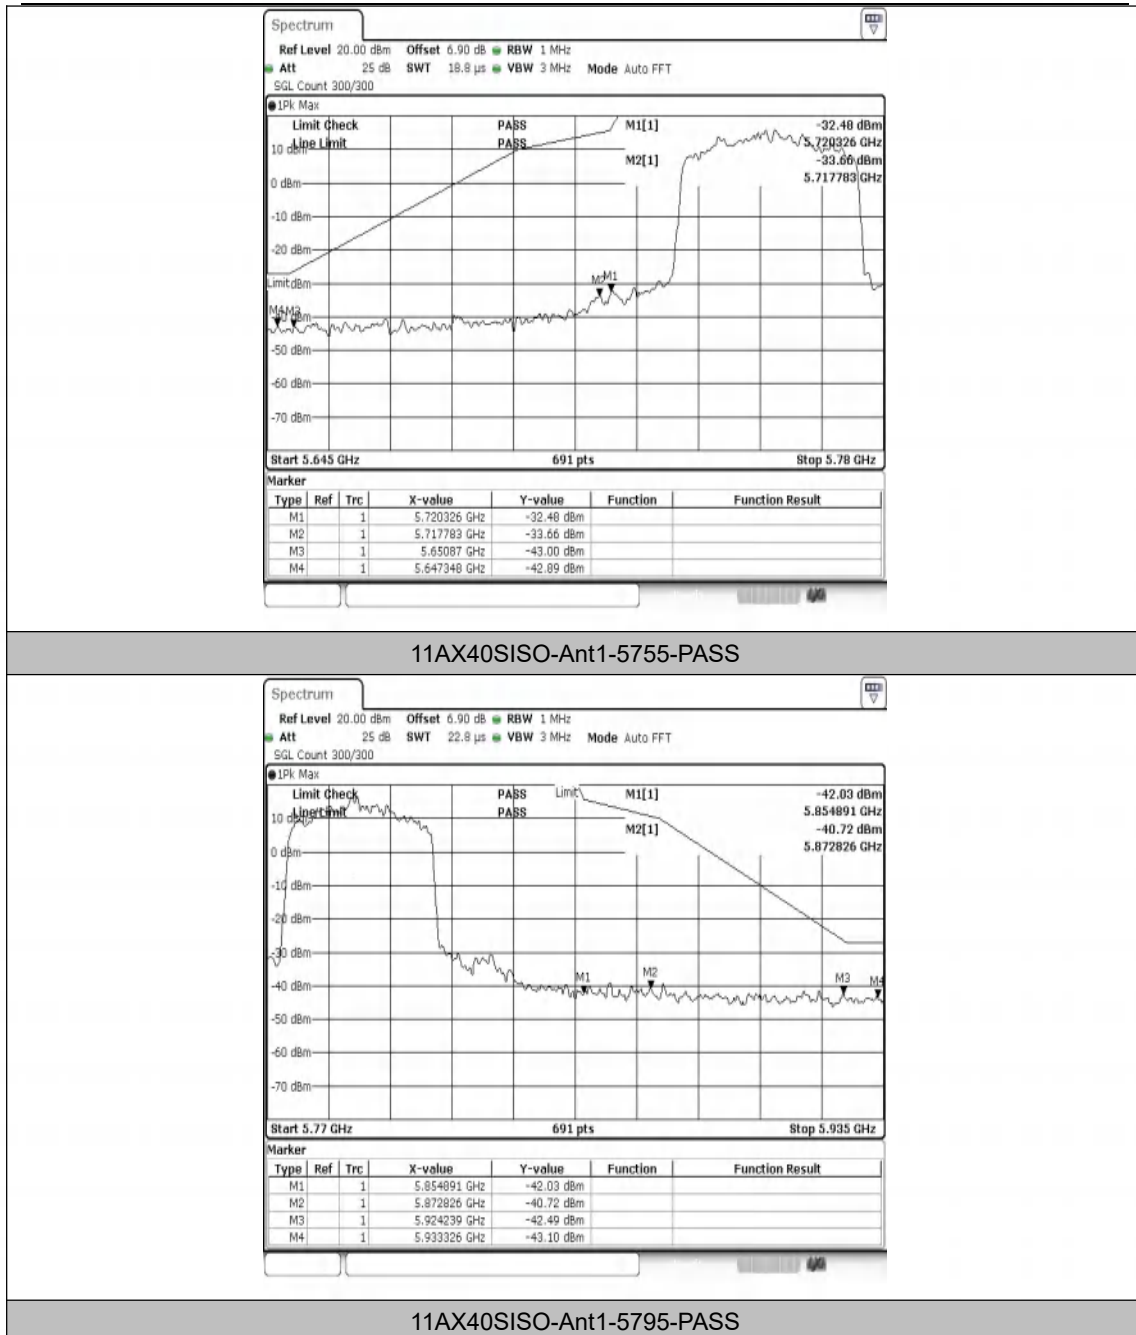

---End---