

Appendix Test Data

Report No.:	1812C60044712504-01	Test Sample No.:	1-2-2
Start Test Date:	2026-1-15	Finish Test Date:	2026-1-29
Test Engineer:	Pearl Ao	Auditor:	Justin Feng
Temperature:	22.1°C	Relative Humidity:	61%
Pressure:	101kPa		



Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	20.280	5169.800	5190.080	---	---
11A	Ant1	5220	20.360	5209.760	5230.120	---	---
11A	Ant1	5240	20.040	5229.960	5250.000	---	---
11A	Ant1	5260	20.320	5249.880	5270.200	---	---
11A	Ant1	5300	20.200	5289.840	5310.040	---	---
11A	Ant1	5320	20.280	5309.840	5330.120	---	---
11A	Ant1	5500	20.240	5489.920	5510.160	---	---
11A	Ant1	5580	20.200	5569.960	5590.160	---	---
11A	Ant1	5700	20.040	5689.960	5710.000	---	---
11A	Ant1	5745	20.320	5734.840	5755.160	---	---
11A	Ant1	5785	20.240	5774.840	5795.080	---	---
11A	Ant1	5825	20.280	5814.800	5835.080	---	---
11N20SISO	Ant1	5180	20.760	5169.680	5190.440	---	---
11N20SISO	Ant1	5220	20.640	5209.680	5230.320	---	---
11N20SISO	Ant1	5240	20.520	5229.760	5250.280	---	---
11N20SISO	Ant1	5260	20.680	5249.720	5270.400	---	---
11N20SISO	Ant1	5300	20.480	5289.800	5310.280	---	---
11N20SISO	Ant1	5320	20.680	5309.680	5330.360	---	---
11N20SISO	Ant1	5500	20.520	5489.680	5510.200	---	---
11N20SISO	Ant1	5580	20.720	5569.680	5590.400	---	---
11N20SISO	Ant1	5700	20.640	5689.680	5710.320	---	---
11N20SISO	Ant1	5745	20.520	5734.760	5755.280	---	---
11N20SISO	Ant1	5785	20.320	5774.920	5795.240	---	---
11N20SISO	Ant1	5825	20.480	5814.720	5835.200	---	---
11N40SISO	Ant1	5190	41.040	5169.520	5210.560	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11N40SISO	Ant1	5230	41.120	5209.440	5250.560	---	---
11N40SISO	Ant1	5270	40.880	5249.520	5290.400	---	---
11N40SISO	Ant1	5310	40.800	5289.600	5330.400	---	---
11N40SISO	Ant1	5510	41.200	5489.360	5530.560	---	---
11N40SISO	Ant1	5550	40.720	5529.520	5570.240	---	---
11N40SISO	Ant1	5670	40.960	5649.600	5690.560	---	---
11N40SISO	Ant1	5755	41.440	5734.360	5775.800	---	---
11N40SISO	Ant1	5795	41.280	5774.360	5815.640	---	---
11AC20SISO	Ant1	5180	20.800	5169.560	5190.360	---	---
11AC20SISO	Ant1	5220	20.600	5209.760	5230.360	---	---
11AC20SISO	Ant1	5240	20.800	5229.560	5250.360	---	---
11AC20SISO	Ant1	5260	20.560	5249.720	5270.280	---	---
11AC20SISO	Ant1	5300	20.480	5289.840	5310.320	---	---
11AC20SISO	Ant1	5320	20.640	5309.680	5330.320	---	---
11AC20SISO	Ant1	5500	20.680	5489.680	5510.360	---	---
11AC20SISO	Ant1	5580	20.480	5569.840	5590.320	---	---
11AC20SISO	Ant1	5700	20.440	5689.760	5710.200	---	---
11AC20SISO	Ant1	5745	20.640	5734.640	5755.280	---	---
11AC20SISO	Ant1	5785	20.600	5774.760	5795.360	---	---
11AC20SISO	Ant1	5825	20.600	5814.720	5835.320	---	---
11AC40SISO	Ant1	5190	40.960	5169.600	5210.560	---	---
11AC40SISO	Ant1	5230	41.360	5209.200	5250.560	---	---
11AC40SISO	Ant1	5270	41.040	5249.600	5290.640	---	---
11AC40SISO	Ant1	5310	40.800	5289.680	5330.480	---	---
11AC40SISO	Ant1	5510	40.800	5489.760	5530.560	---	---
11AC40SISO	Ant1	5550	40.720	5529.440	5570.160	---	---
11AC40SISO	Ant1	5670	40.640	5649.680	5690.320	---	---
11AC40SISO	Ant1	5755	41.120	5734.600	5775.720	---	---
11AC40SISO	Ant1	5795	41.600	5774.280	5815.880	---	---
11AC80SISO	Ant1	5210	81.920	5169.200	5251.120	---	---
11AC80SISO	Ant1	5290	81.280	5249.520	5330.800	---	---
11AC80SISO	Ant1	5530	81.600	5489.360	5570.960	---	---
11AC80SISO	Ant1	5775	81.920	5734.040	5815.960	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

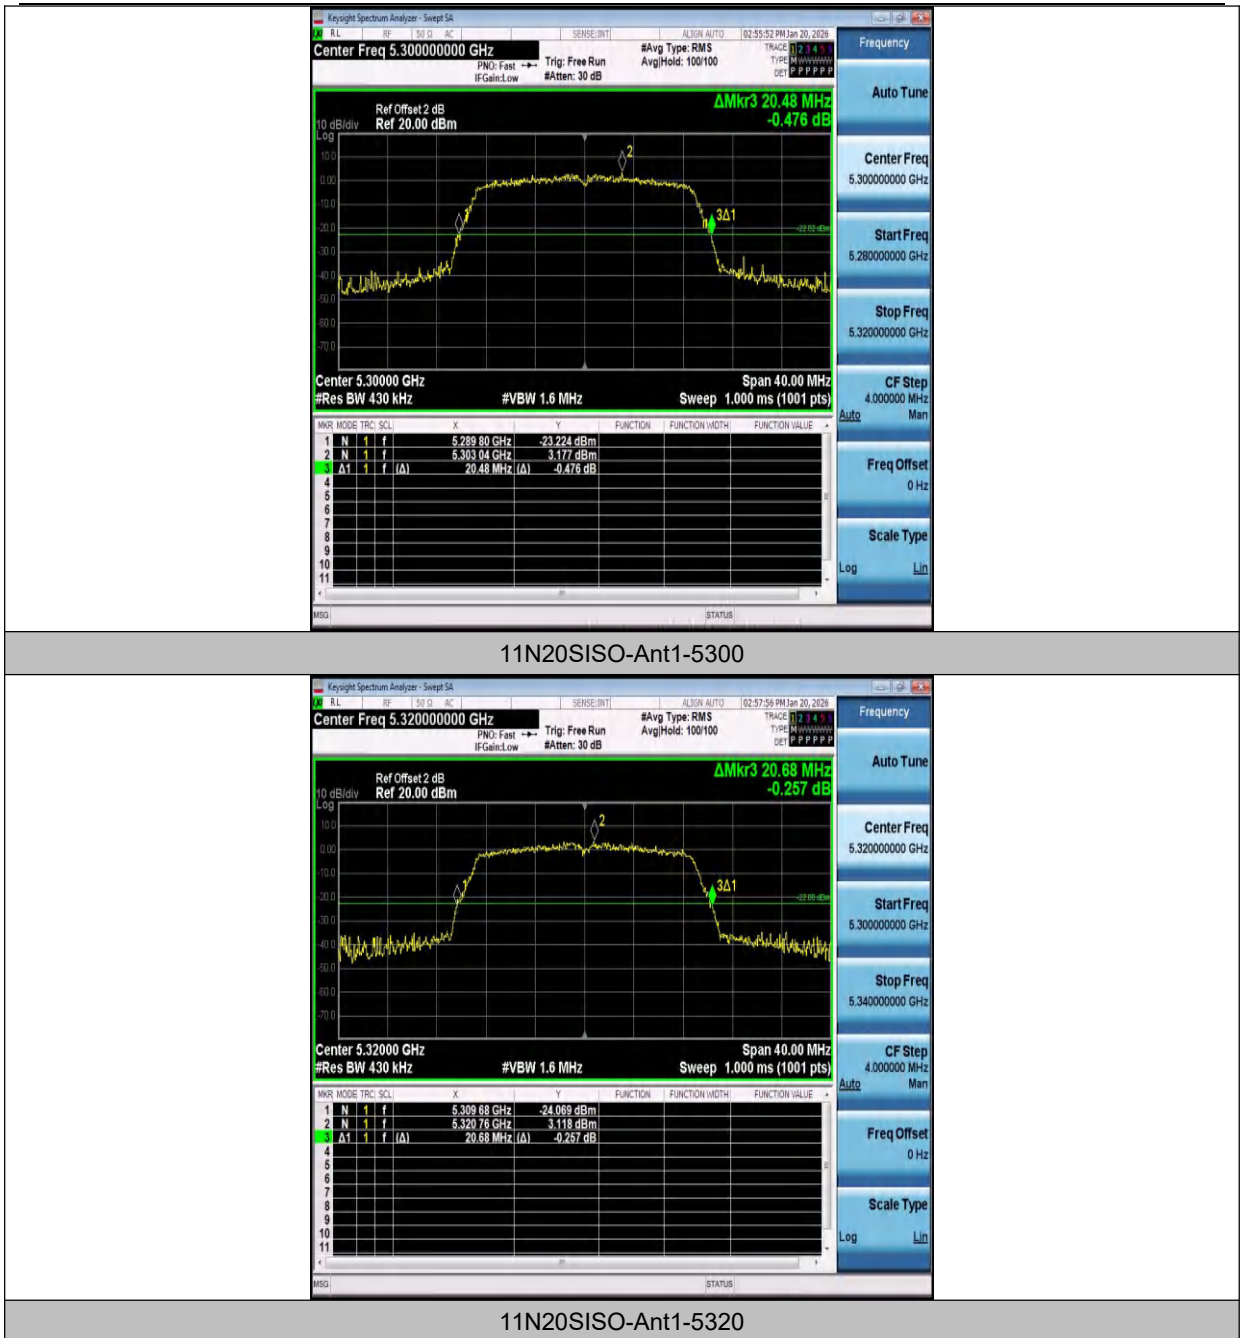


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

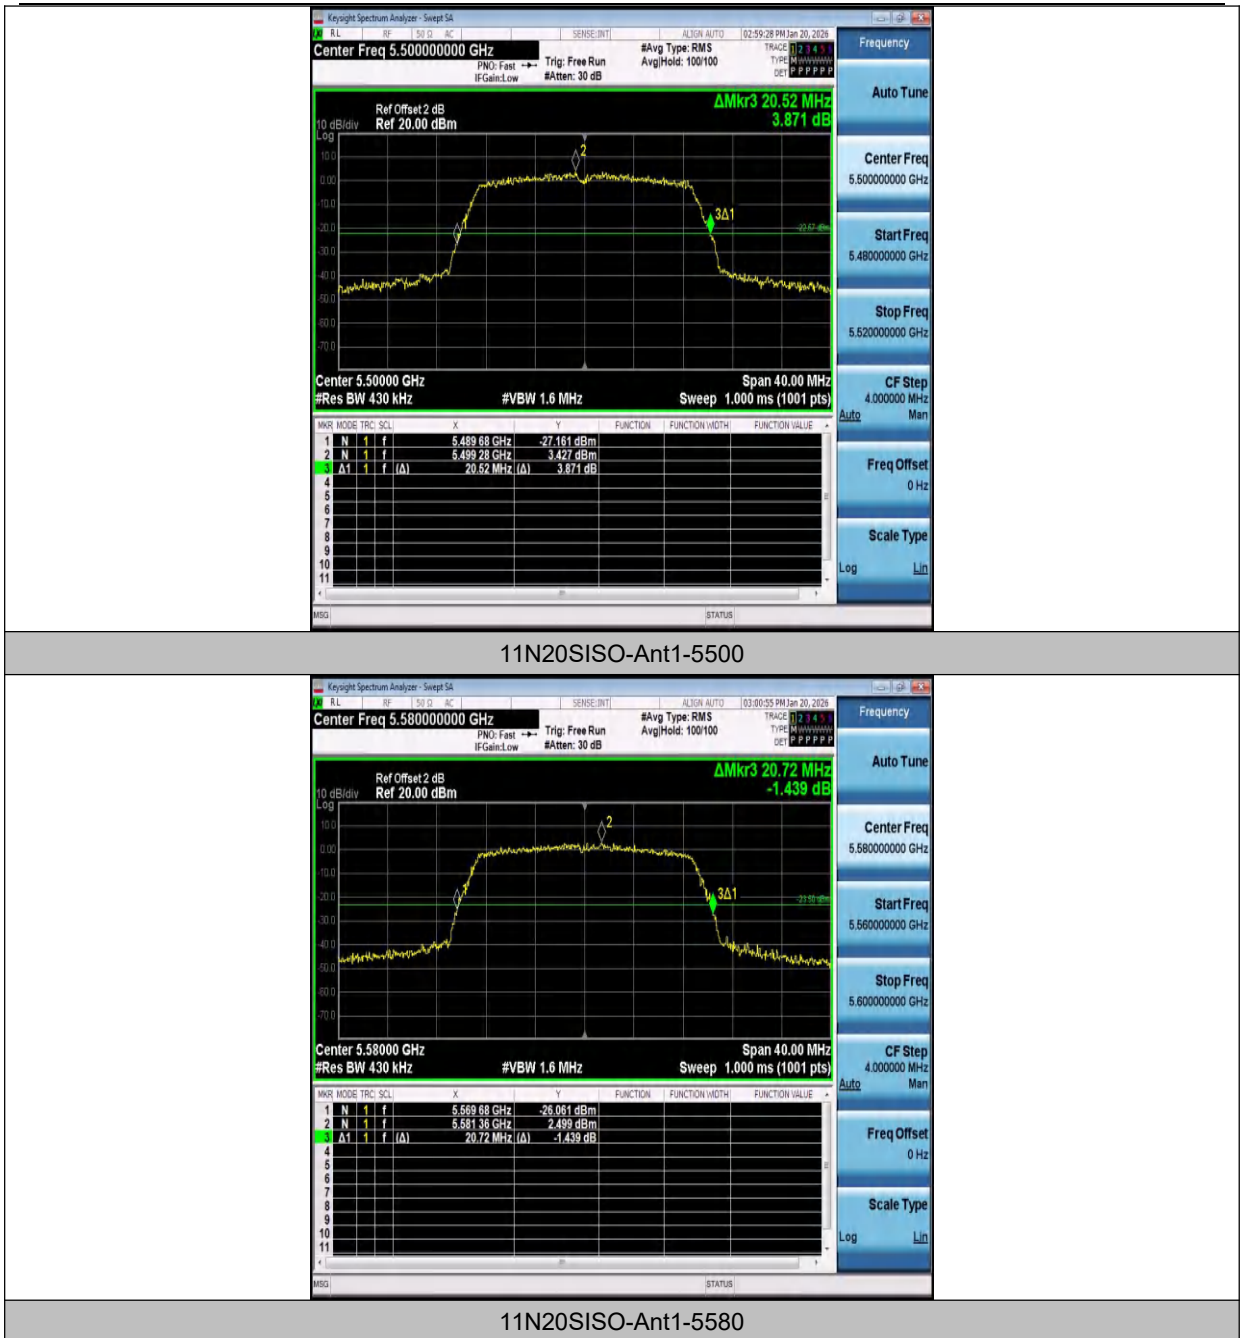

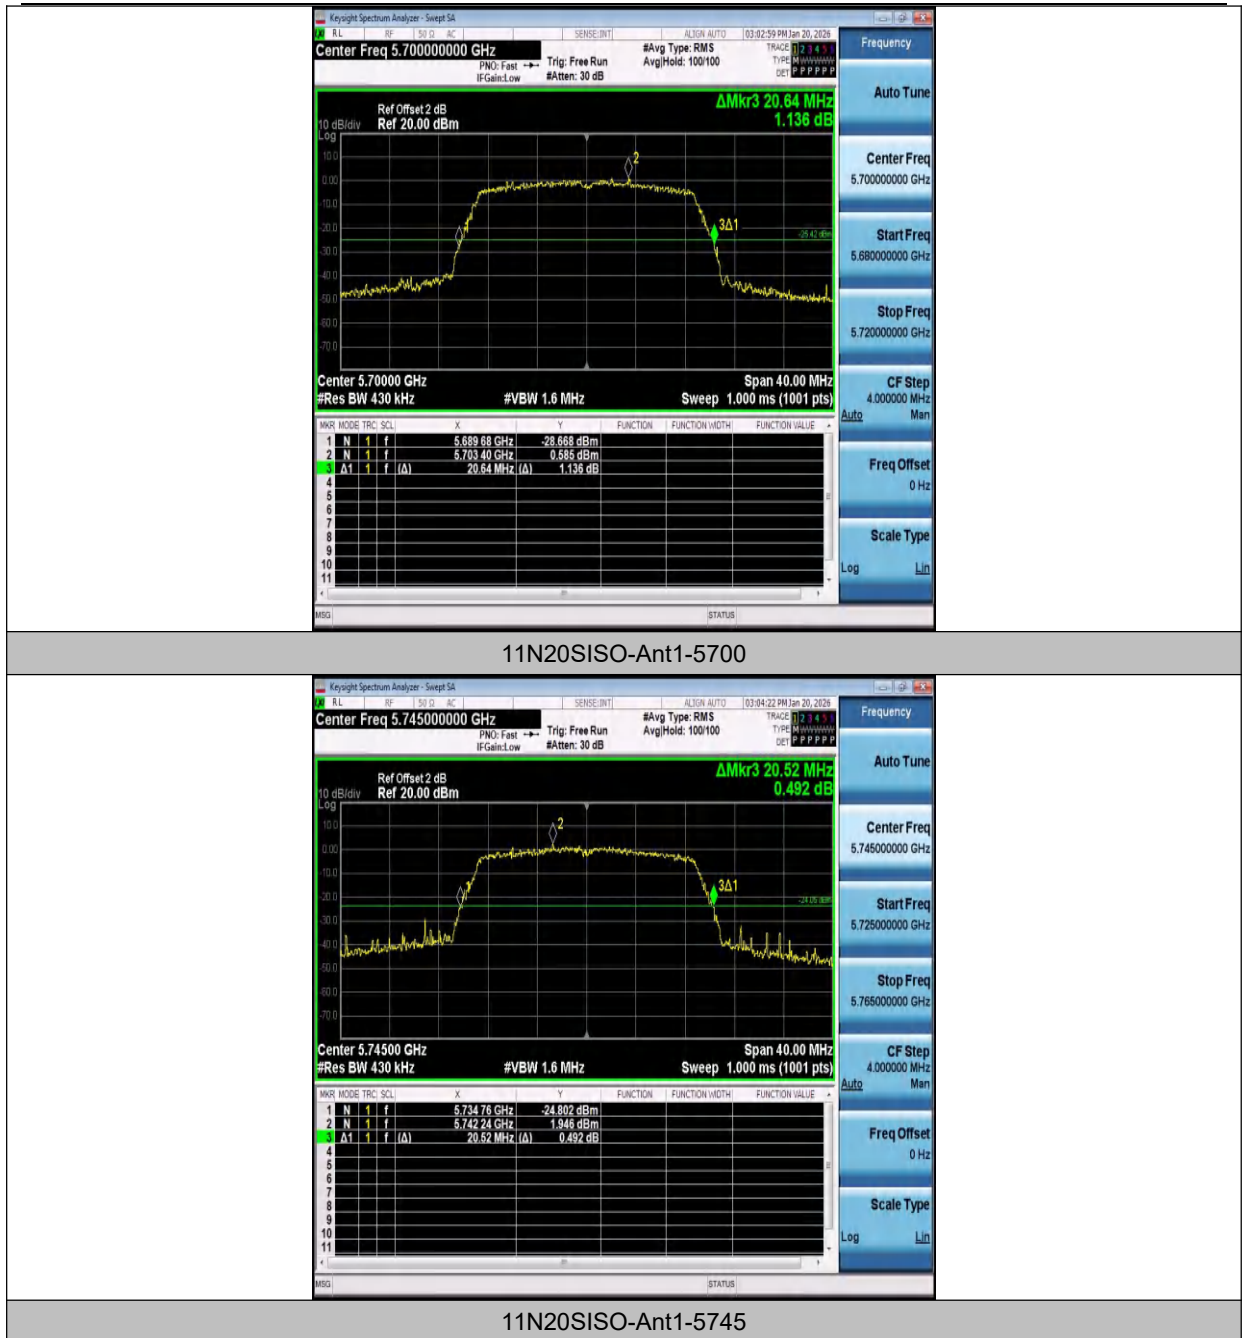







Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com





Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com







Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

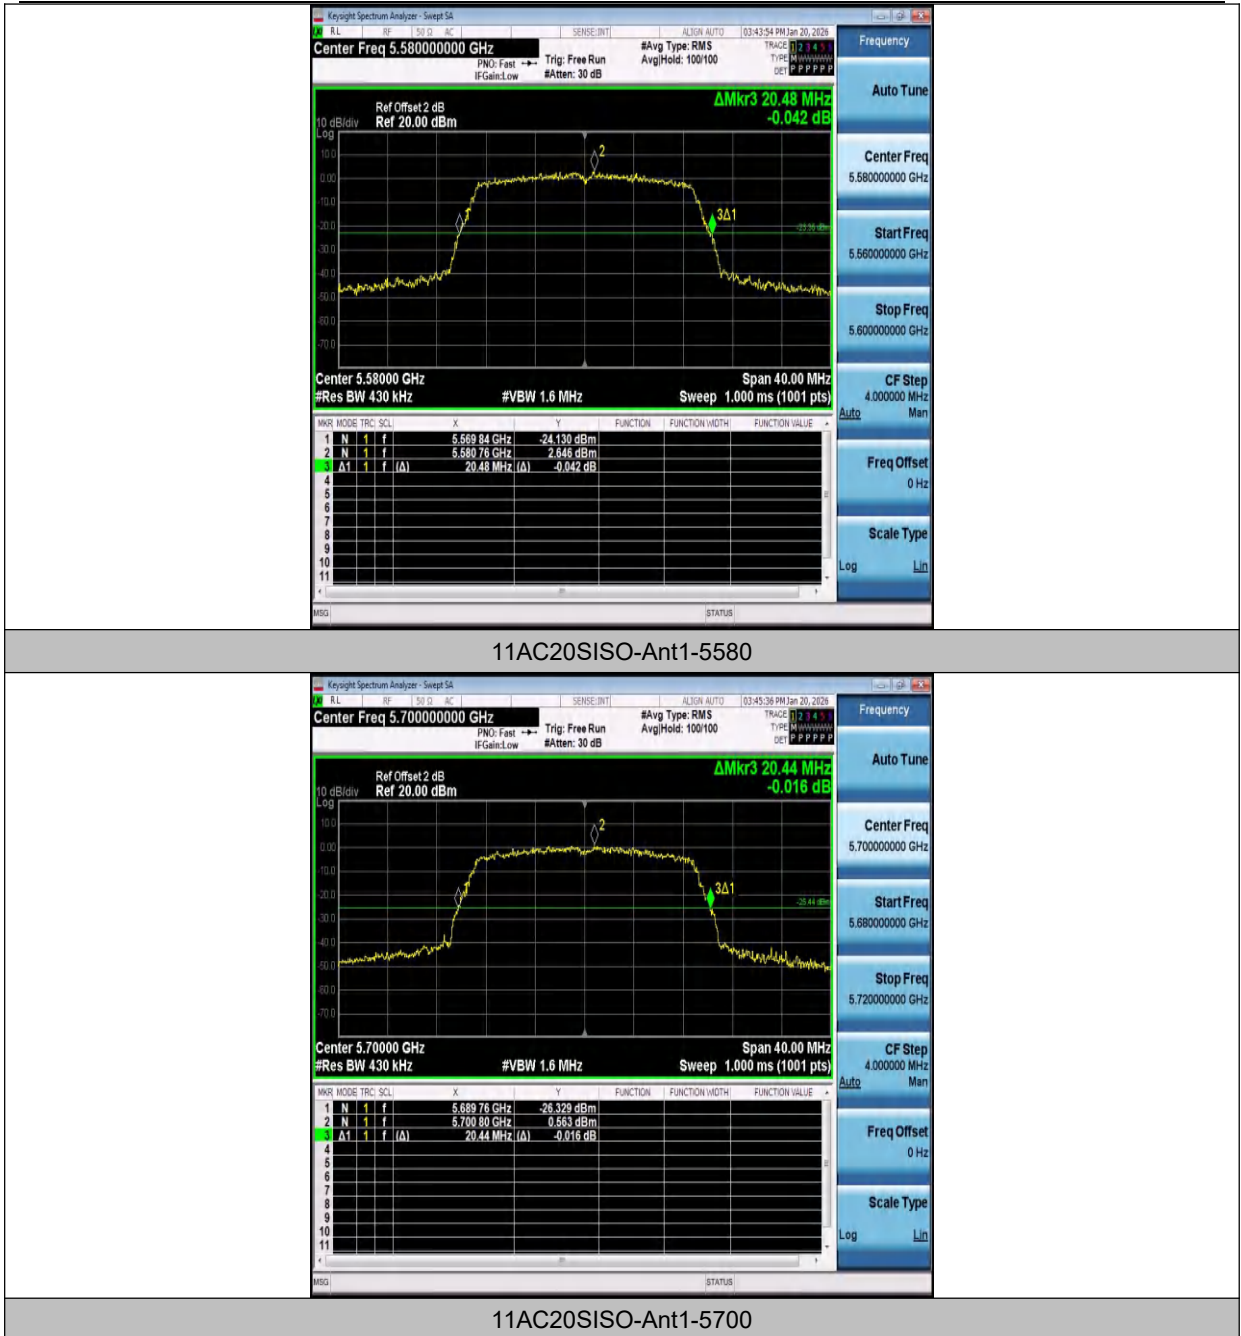

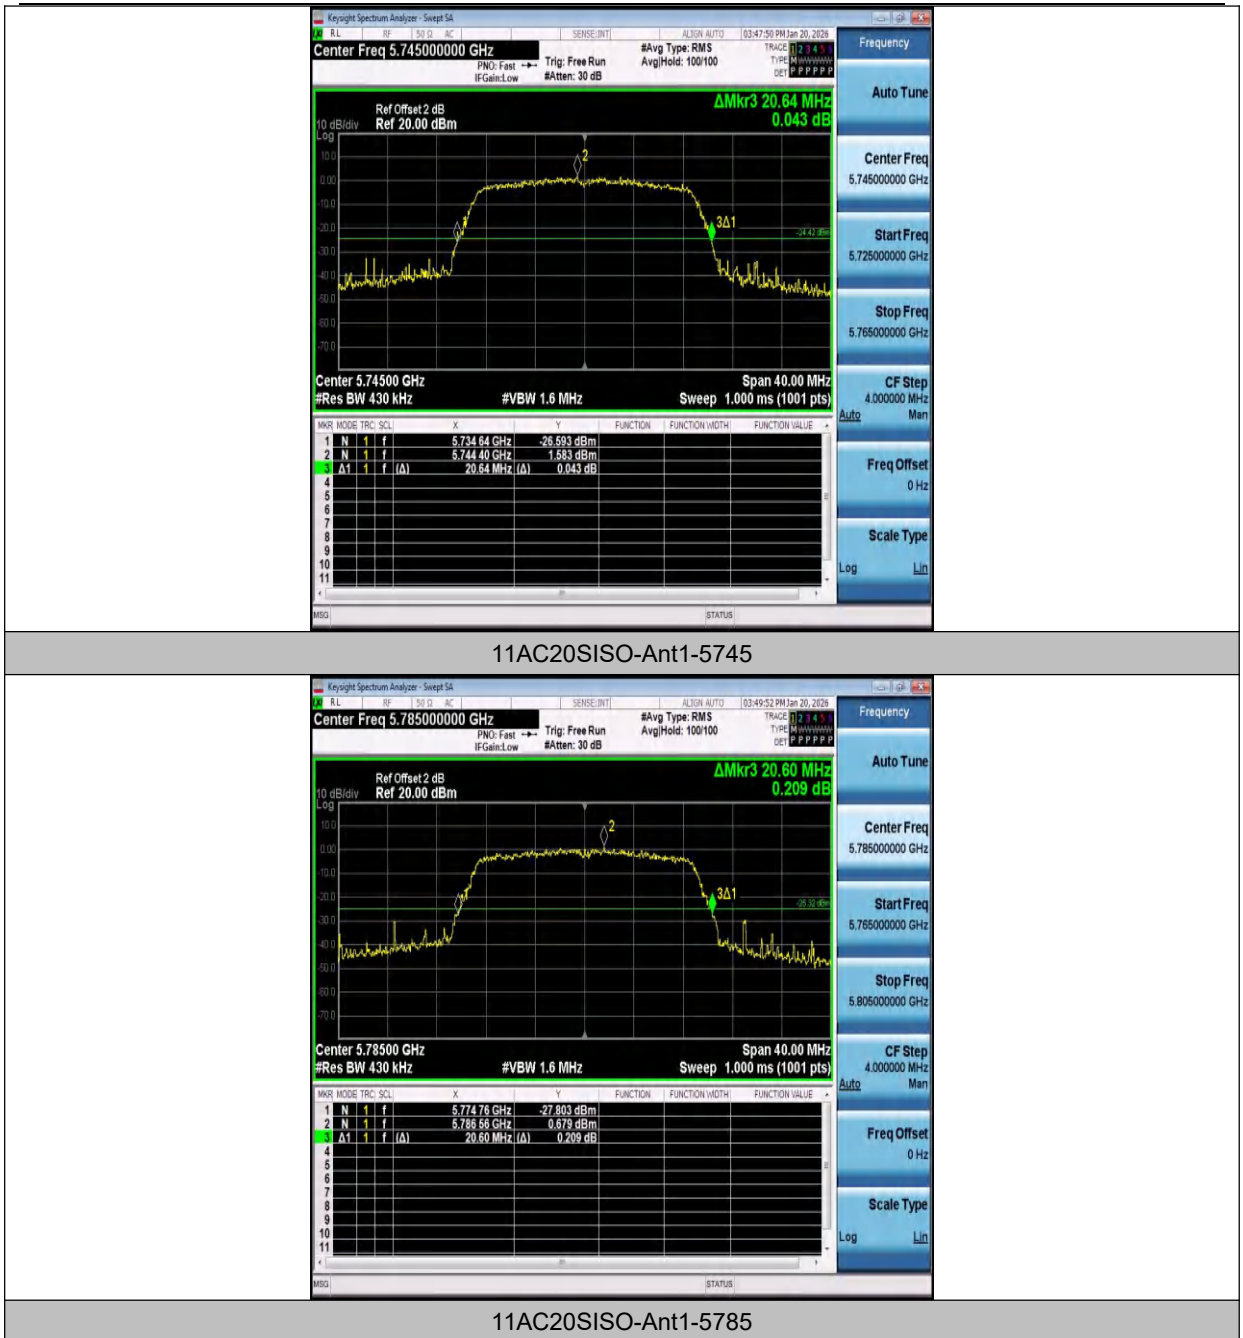


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com






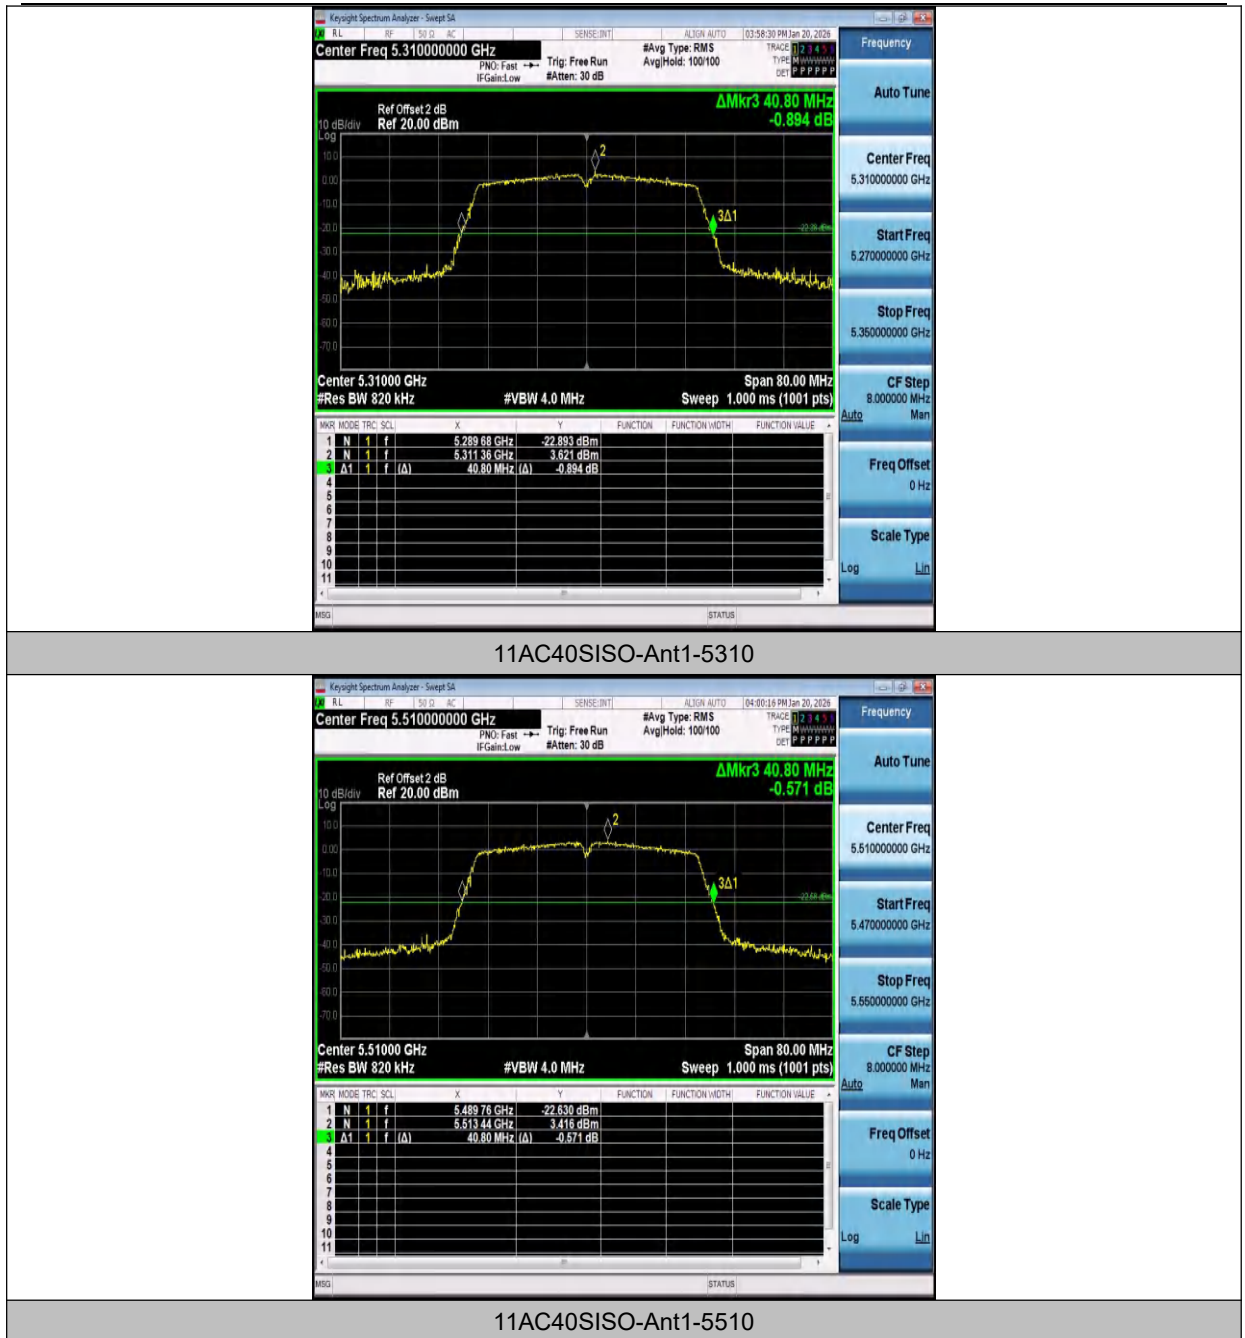

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

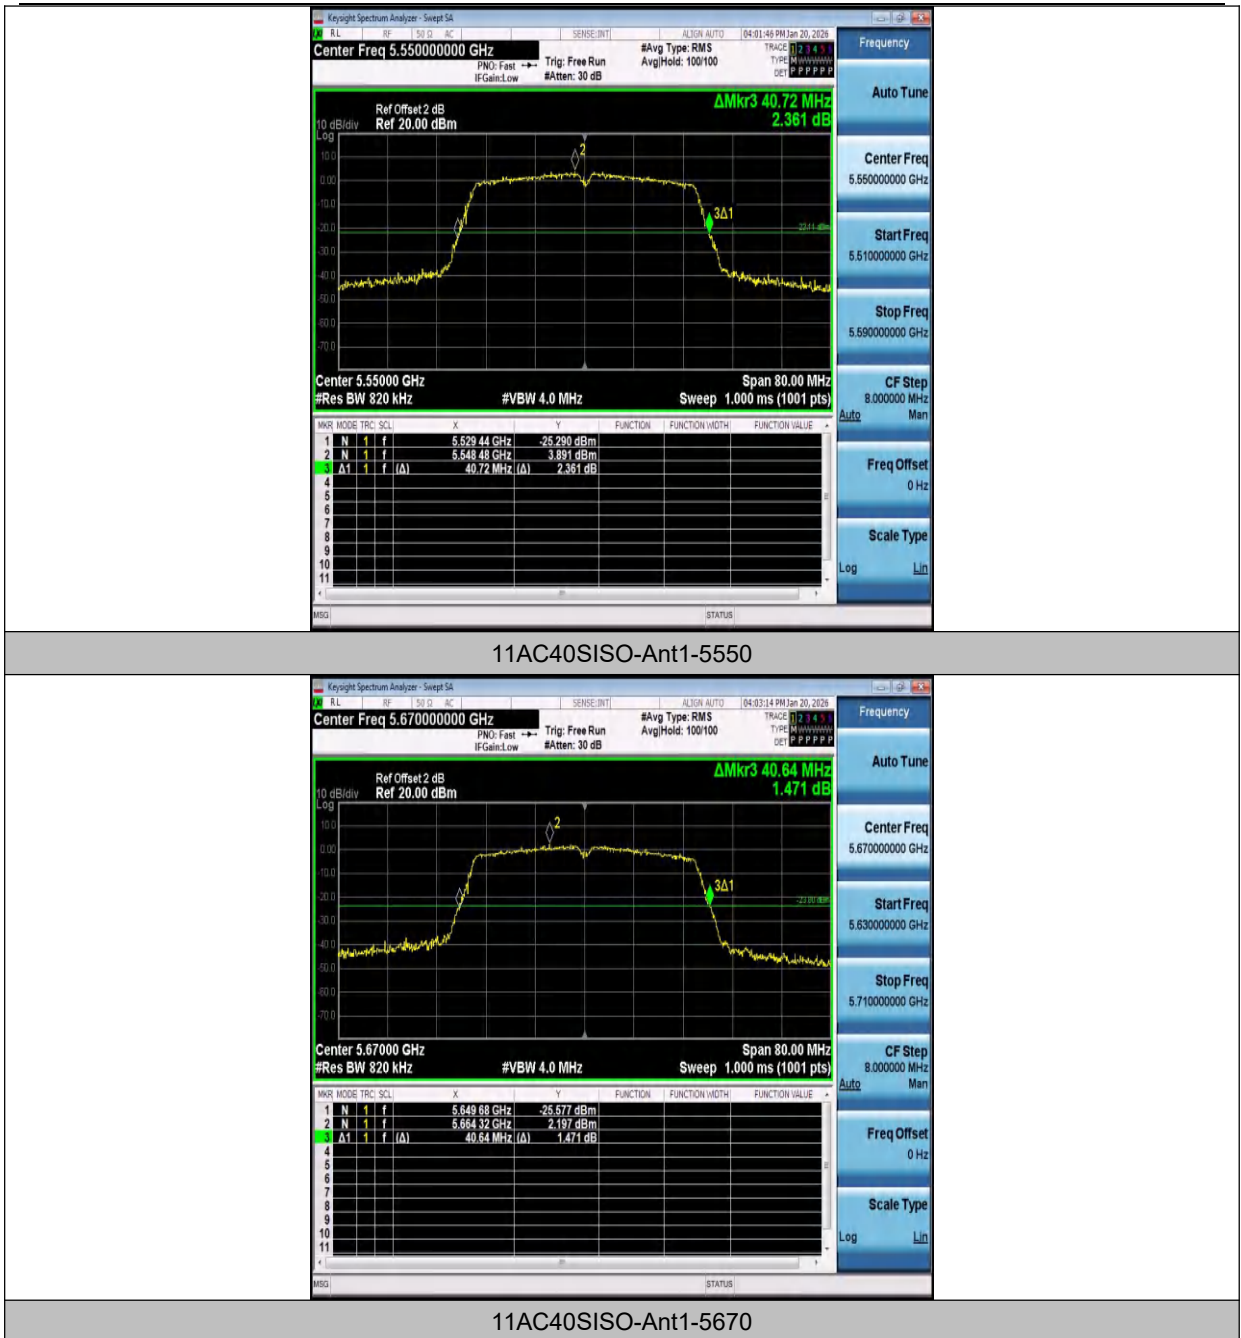

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

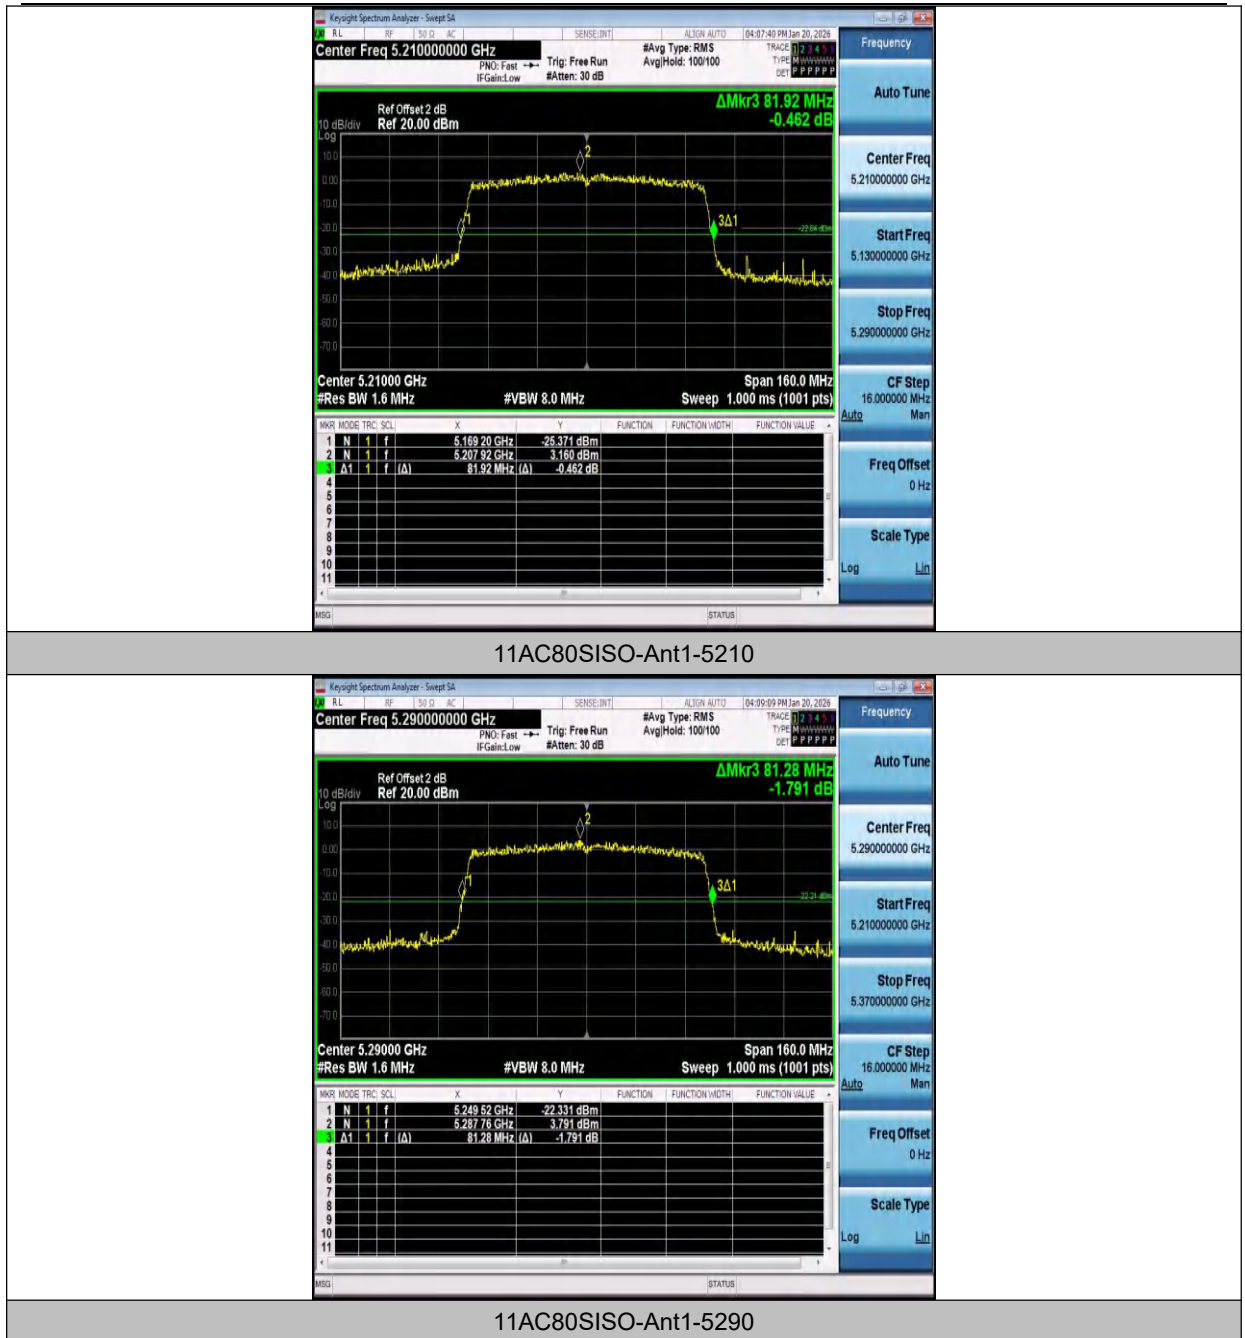

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

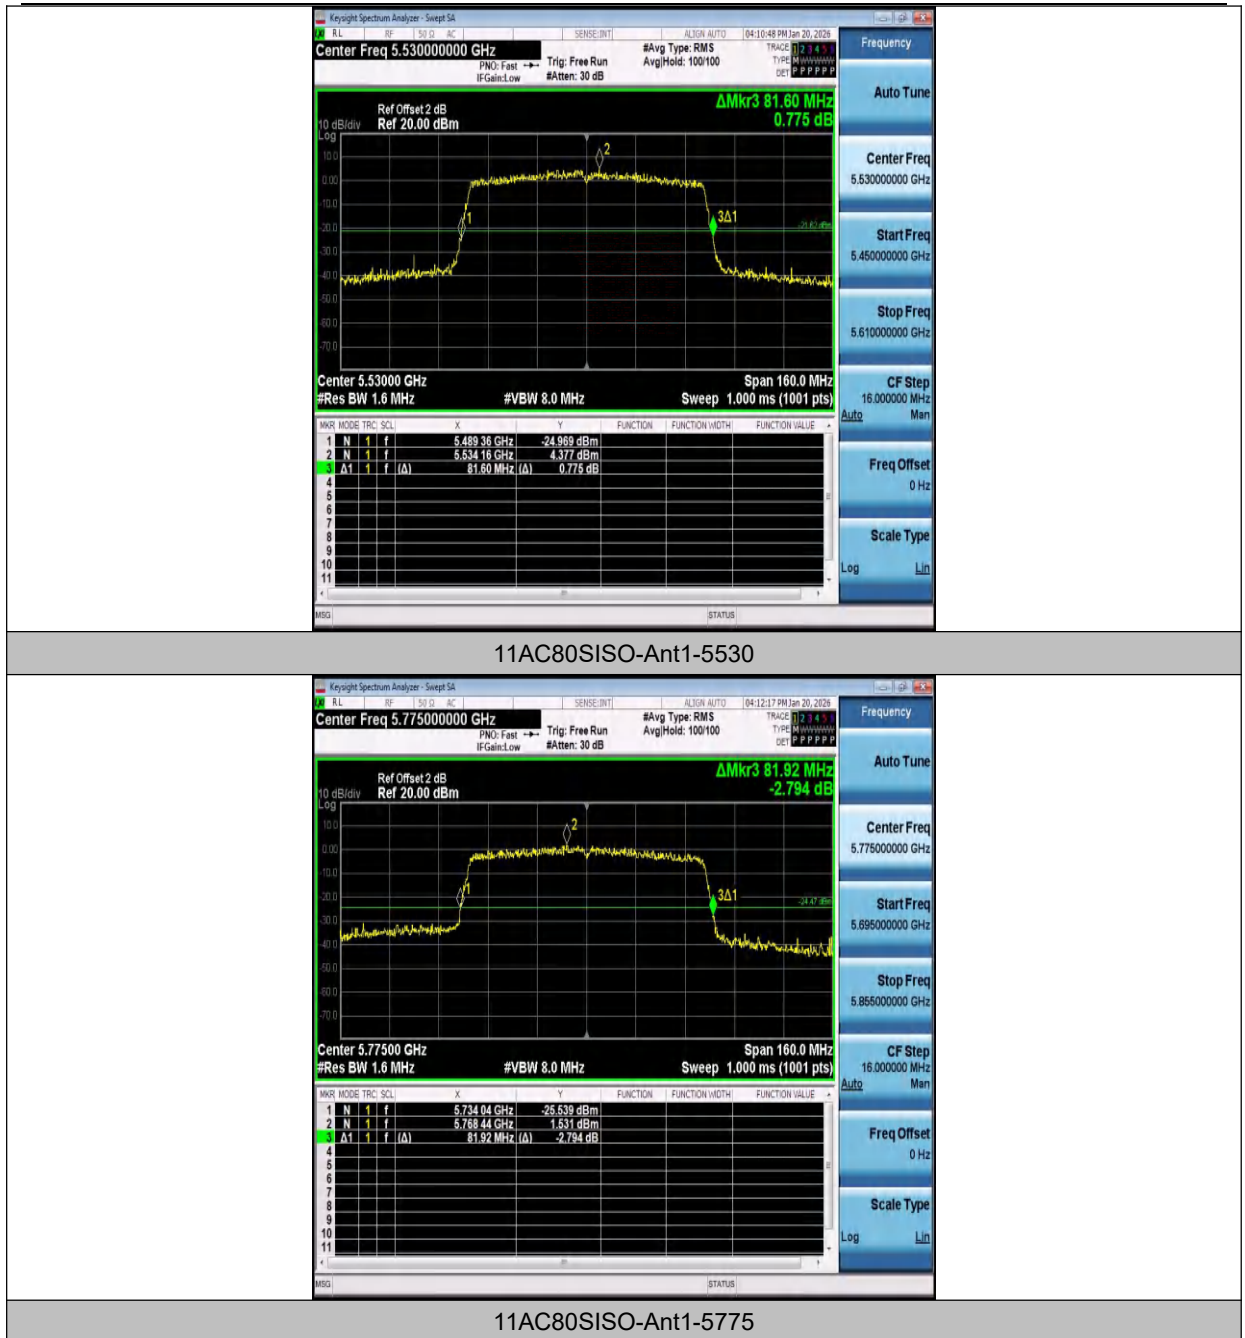

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	16.769	5171.6615	5188.4305	---	---
11A	Ant1	5220	16.781	5211.6528	5228.4338	---	---
11A	Ant1	5240	16.729	5231.6457	5248.3747	---	---
11A	Ant1	5260	16.809	5251.6290	5268.4380	---	---
11A	Ant1	5300	16.847	5291.6014	5308.4484	---	---
11A	Ant1	5320	16.763	5311.6436	5328.4066	---	---
11A	Ant1	5500	16.756	5491.6900	5508.4460	---	---
11A	Ant1	5580	16.748	5571.6126	5588.3606	---	---
11A	Ant1	5700	16.792	5691.5461	5708.3381	---	---
11A	Ant1	5745	16.733	5736.6605	5753.3935	---	---
11A	Ant1	5785	16.847	5776.6062	5793.4532	---	---
11A	Ant1	5825	16.833	5816.6205	5833.4535	---	---
11N20SISO	Ant1	5180	17.757	5171.1542	5188.9112	---	---
11N20SISO	Ant1	5220	17.837	5211.0858	5228.9228	---	---
11N20SISO	Ant1	5240	17.759	5231.1494	5248.9084	---	---
11N20SISO	Ant1	5260	17.785	5251.1281	5268.9131	---	---
11N20SISO	Ant1	5300	17.752	5291.1369	5308.8889	---	---
11N20SISO	Ant1	5320	17.745	5311.1626	5328.9076	---	---
11N20SISO	Ant1	5500	17.762	5491.1423	5508.9043	---	---
11N20SISO	Ant1	5580	17.788	5571.1399	5588.9279	---	---
11N20SISO	Ant1	5700	17.742	5691.1322	5708.8742	---	---
11N20SISO	Ant1	5745	17.734	5736.1535	5753.8875	---	---
11N20SISO	Ant1	5785	17.761	5776.1571	5793.9181	---	---
11N20SISO	Ant1	5825	17.754	5816.1679	5833.9219	---	---
11N40SISO	Ant1	5190	36.110	5171.9648	5208.0748	---	---
11N40SISO	Ant1	5230	36.178	5211.9221	5248.1001	---	---
11N40SISO	Ant1	5270	36.032	5252.0832	5288.1152	---	---
11N40SISO	Ant1	5310	36.021	5292.0666	5328.0876	---	---
11N40SISO	Ant1	5510	35.975	5492.0762	5528.0512	---	---
11N40SISO	Ant1	5550	36.051	5531.9781	5568.0291	---	---
11N40SISO	Ant1	5670	36.097	5651.9558	5688.0528	---	---
11N40SISO	Ant1	5755	36.087	5736.9994	5773.0864	---	---
11N40SISO	Ant1	5795	36.120	5776.9641	5813.0841	---	---
11AC20SISO	Ant1	5180	17.800	5171.1368	5188.9368	---	---
11AC20SISO	Ant1	5220	17.765	5211.1305	5228.8955	---	---
11AC20SISO	Ant1	5240	17.814	5231.0794	5248.8934	---	---
11AC20SISO	Ant1	5260	17.804	5251.1231	5268.9271	---	---
11AC20SISO	Ant1	5300	17.794	5291.1381	5308.9321	---	---


11AC20SISO	Ant1	5320	17.742	5311.1603	5328.9023	---	---
11AC20SISO	Ant1	5500	17.733	5491.1385	5508.8715	---	---
11AC20SISO	Ant1	5580	17.813	5571.1195	5588.9325	---	---
11AC20SISO	Ant1	5700	17.765	5691.0912	5708.8562	---	---
11AC20SISO	Ant1	5745	17.818	5736.0849	5753.9029	---	---
11AC20SISO	Ant1	5785	17.814	5776.1315	5793.9455	---	---
11AC20SISO	Ant1	5825	17.808	5816.1529	5833.9609	---	---
11AC40SISO	Ant1	5190	36.024	5172.0362	5208.0602	---	---
11AC40SISO	Ant1	5230	36.082	5212.0152	5248.0972	---	---
11AC40SISO	Ant1	5270	35.992	5252.0820	5288.0740	---	---
11AC40SISO	Ant1	5310	36.160	5291.9200	5328.0800	---	---
11AC40SISO	Ant1	5510	36.006	5492.0920	5528.0980	---	---
11AC40SISO	Ant1	5550	36.011	5532.0319	5568.0429	---	---
11AC40SISO	Ant1	5670	35.939	5652.0409	5687.9799	---	---
11AC40SISO	Ant1	5755	36.107	5736.9805	5773.0875	---	---
11AC40SISO	Ant1	5795	36.065	5777.0260	5813.0910	---	---
11AC80SISO	Ant1	5210	75.360	5172.4541	5247.8141	---	---
11AC80SISO	Ant1	5290	75.240	5252.4564	5327.6964	---	---
11AC80SISO	Ant1	5530	75.185	5492.5678	5567.7528	---	---
11AC80SISO	Ant1	5775	75.578	5737.2462	5812.8242	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs

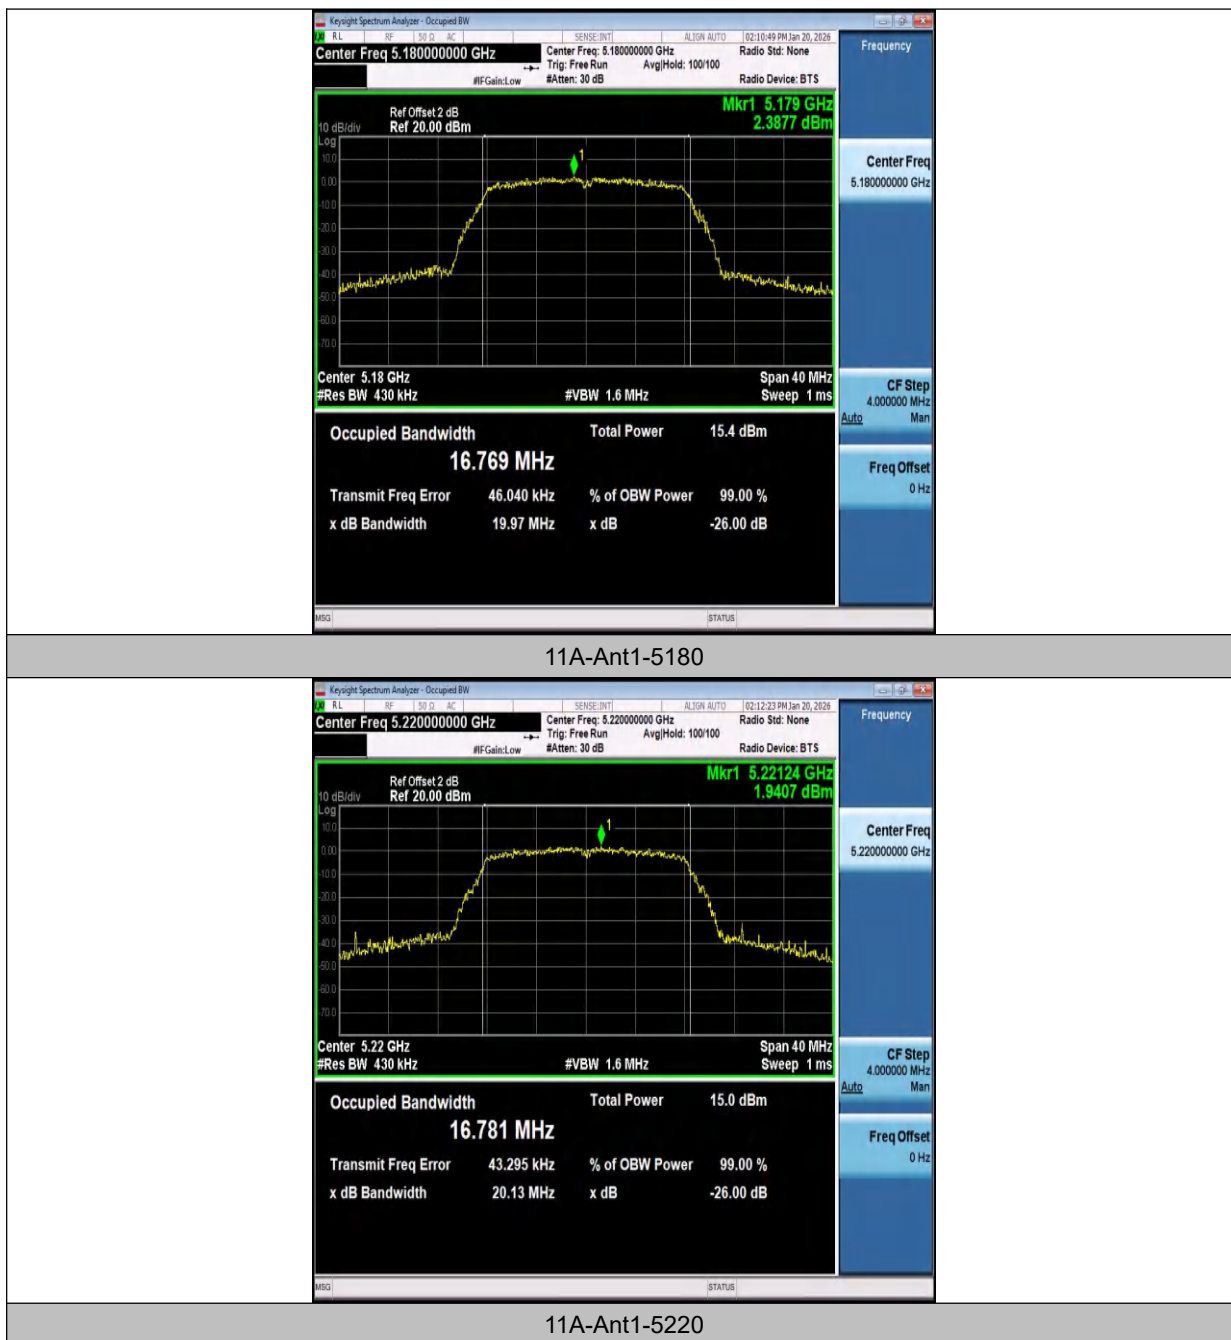

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

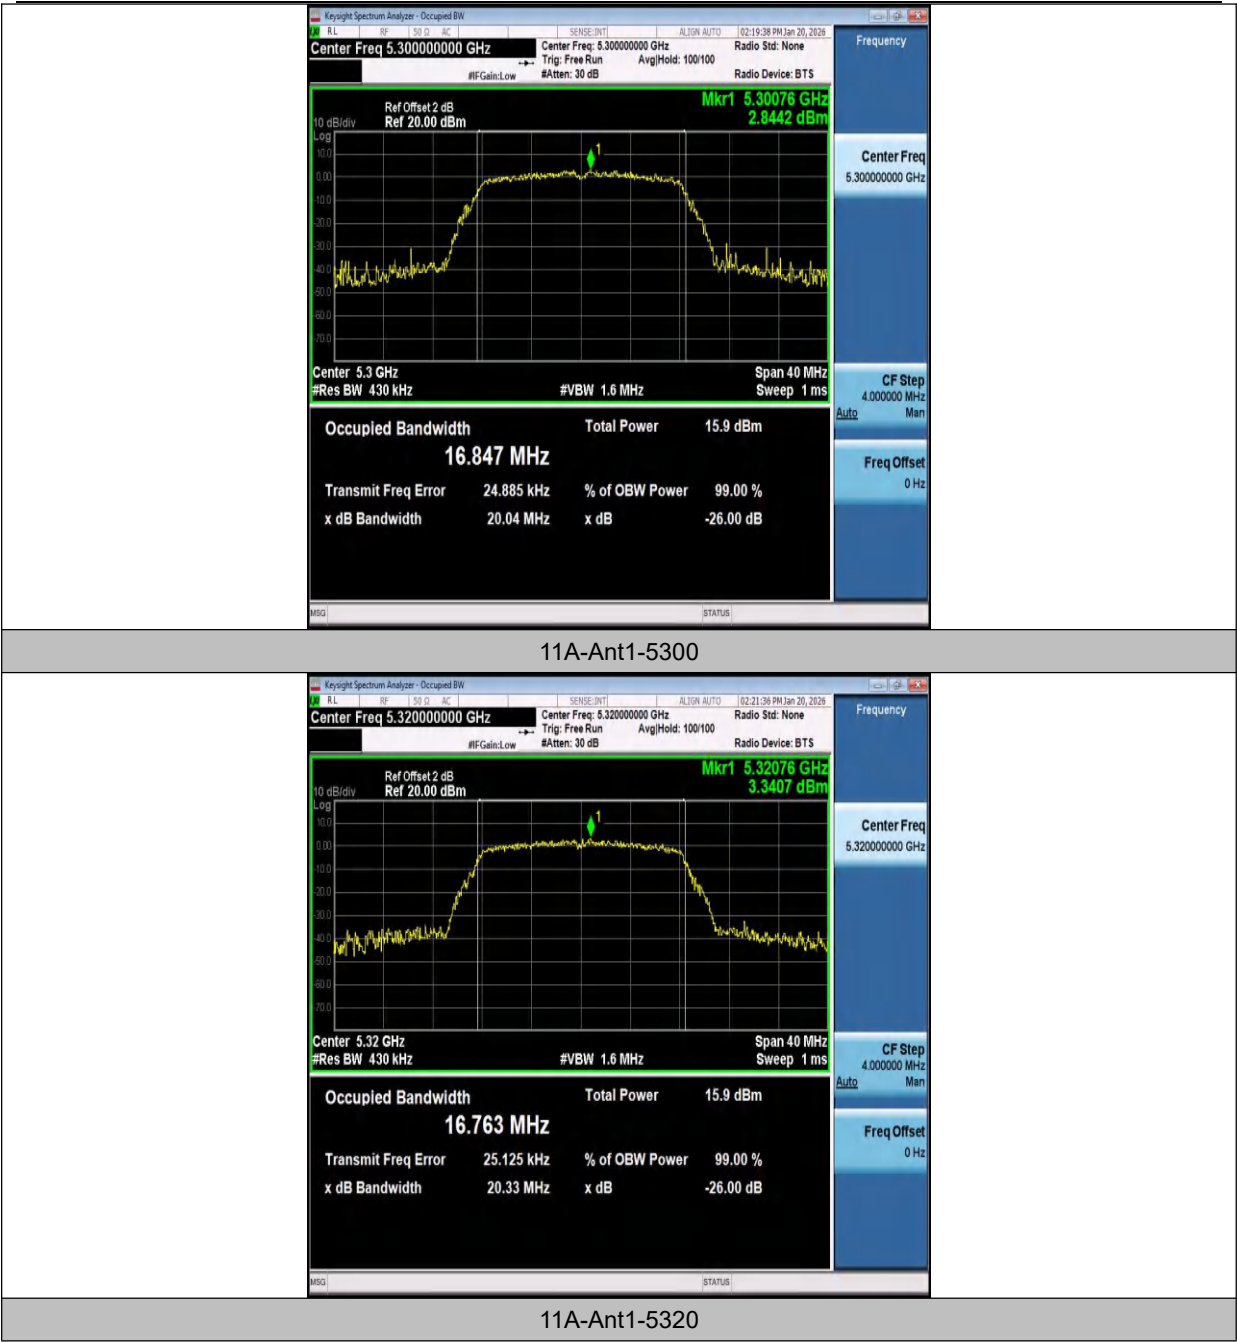

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

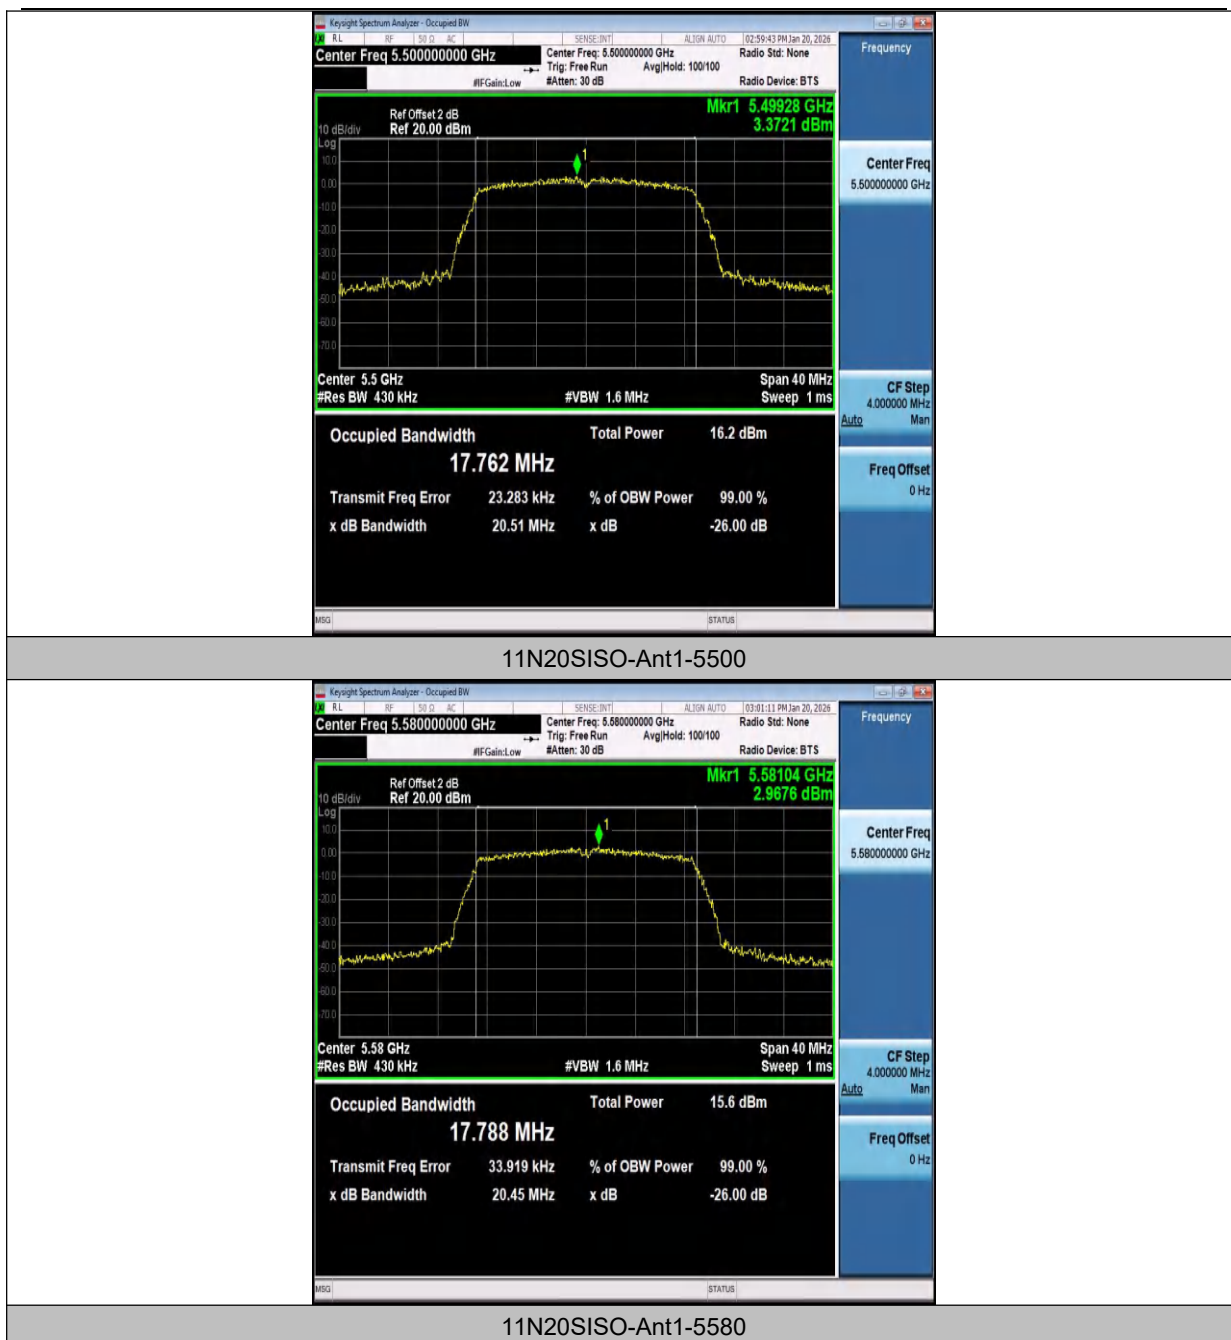

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

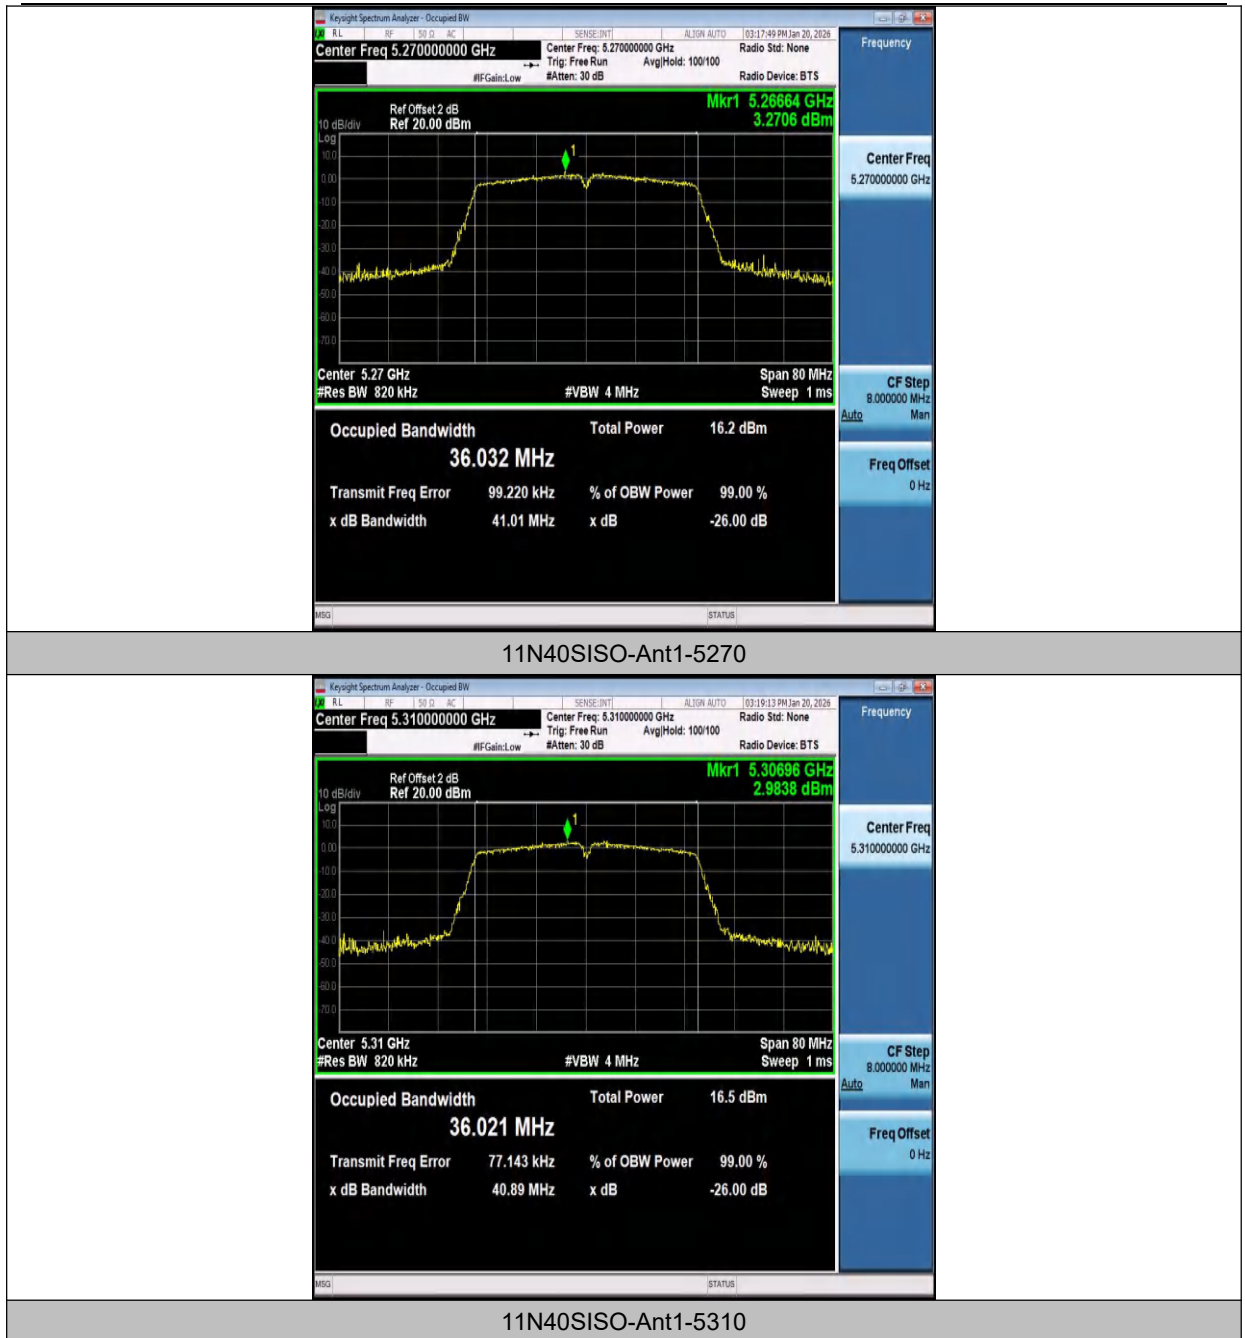

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

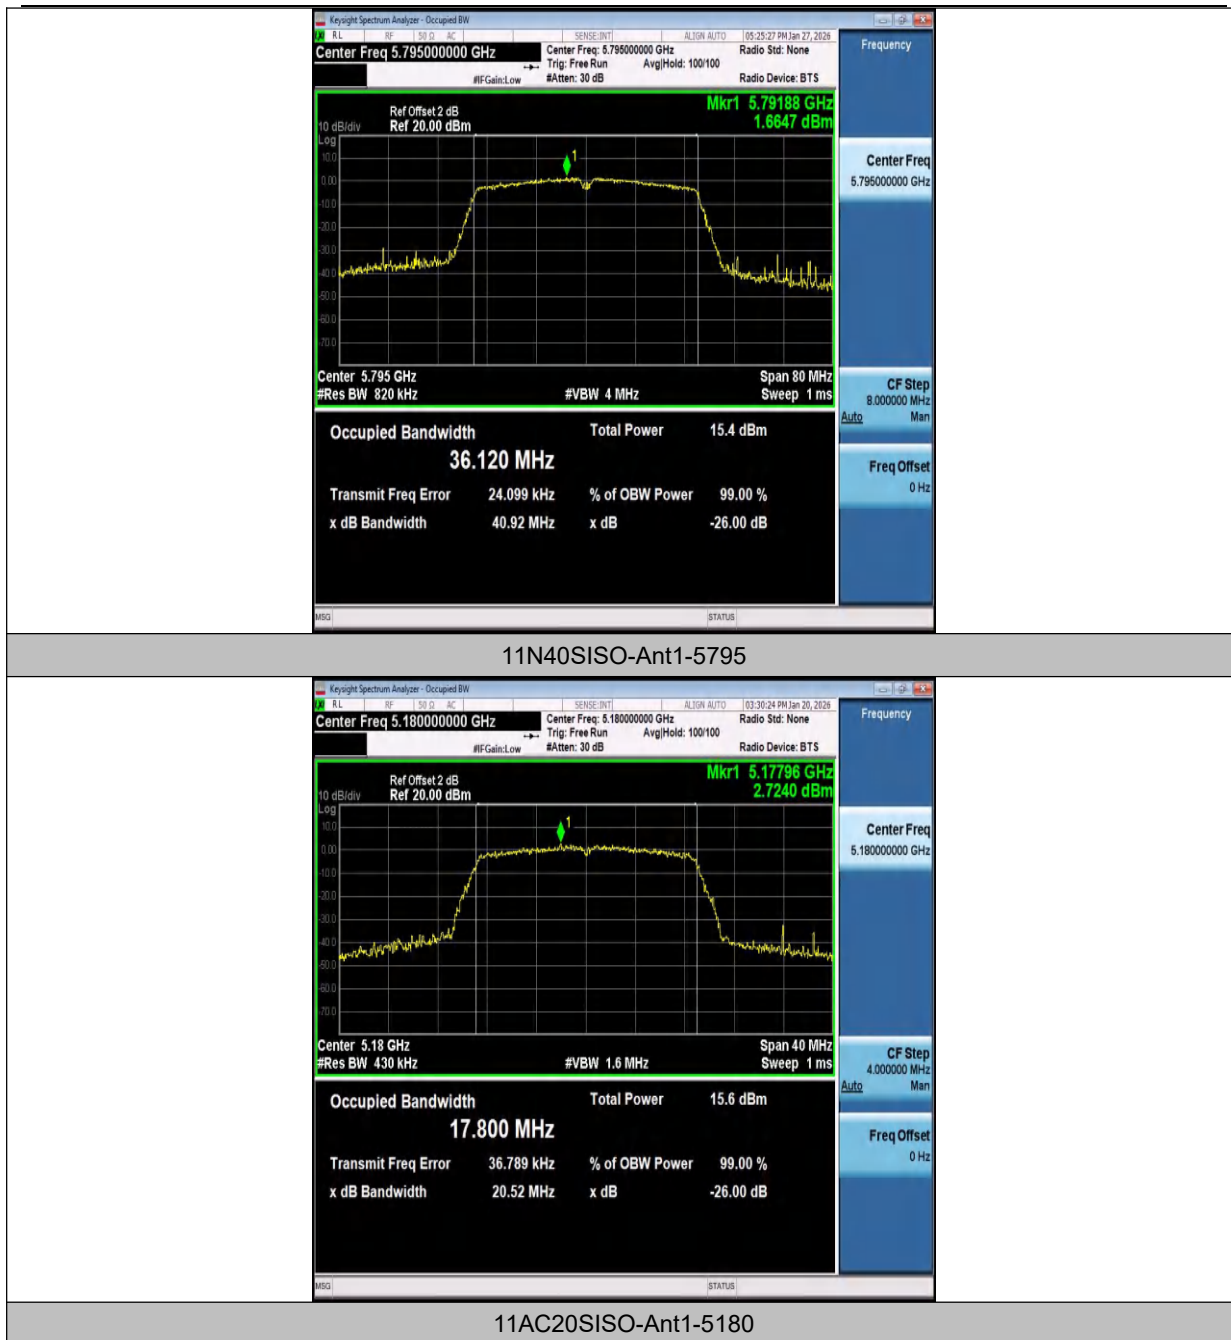

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

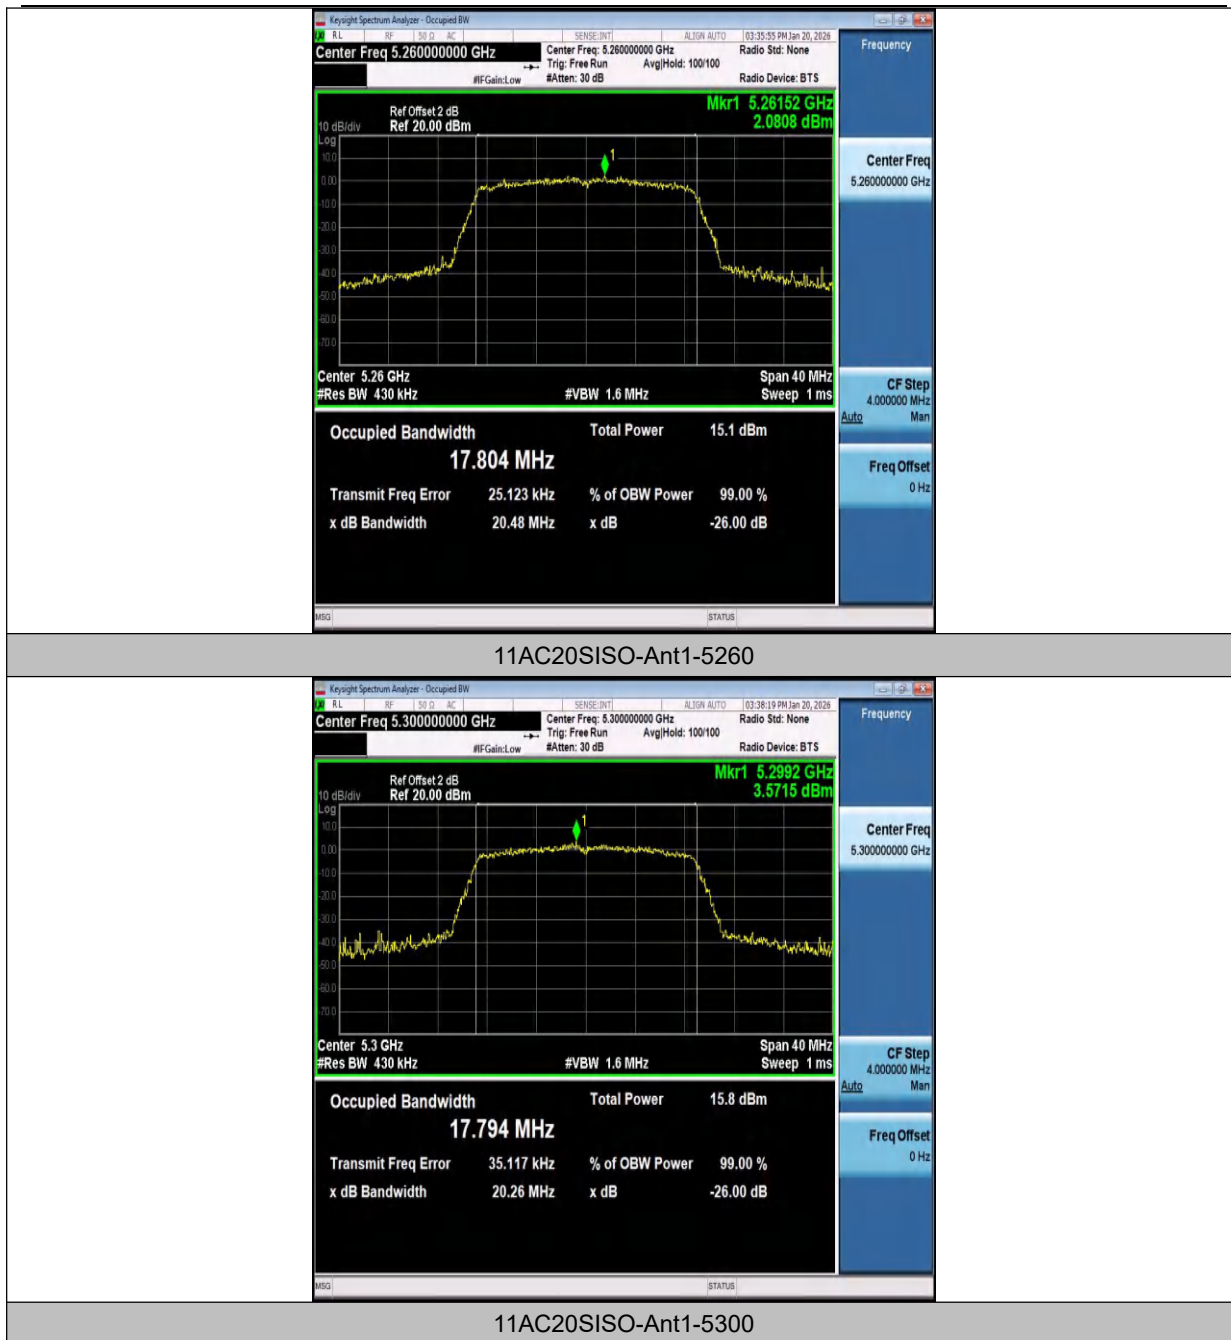


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

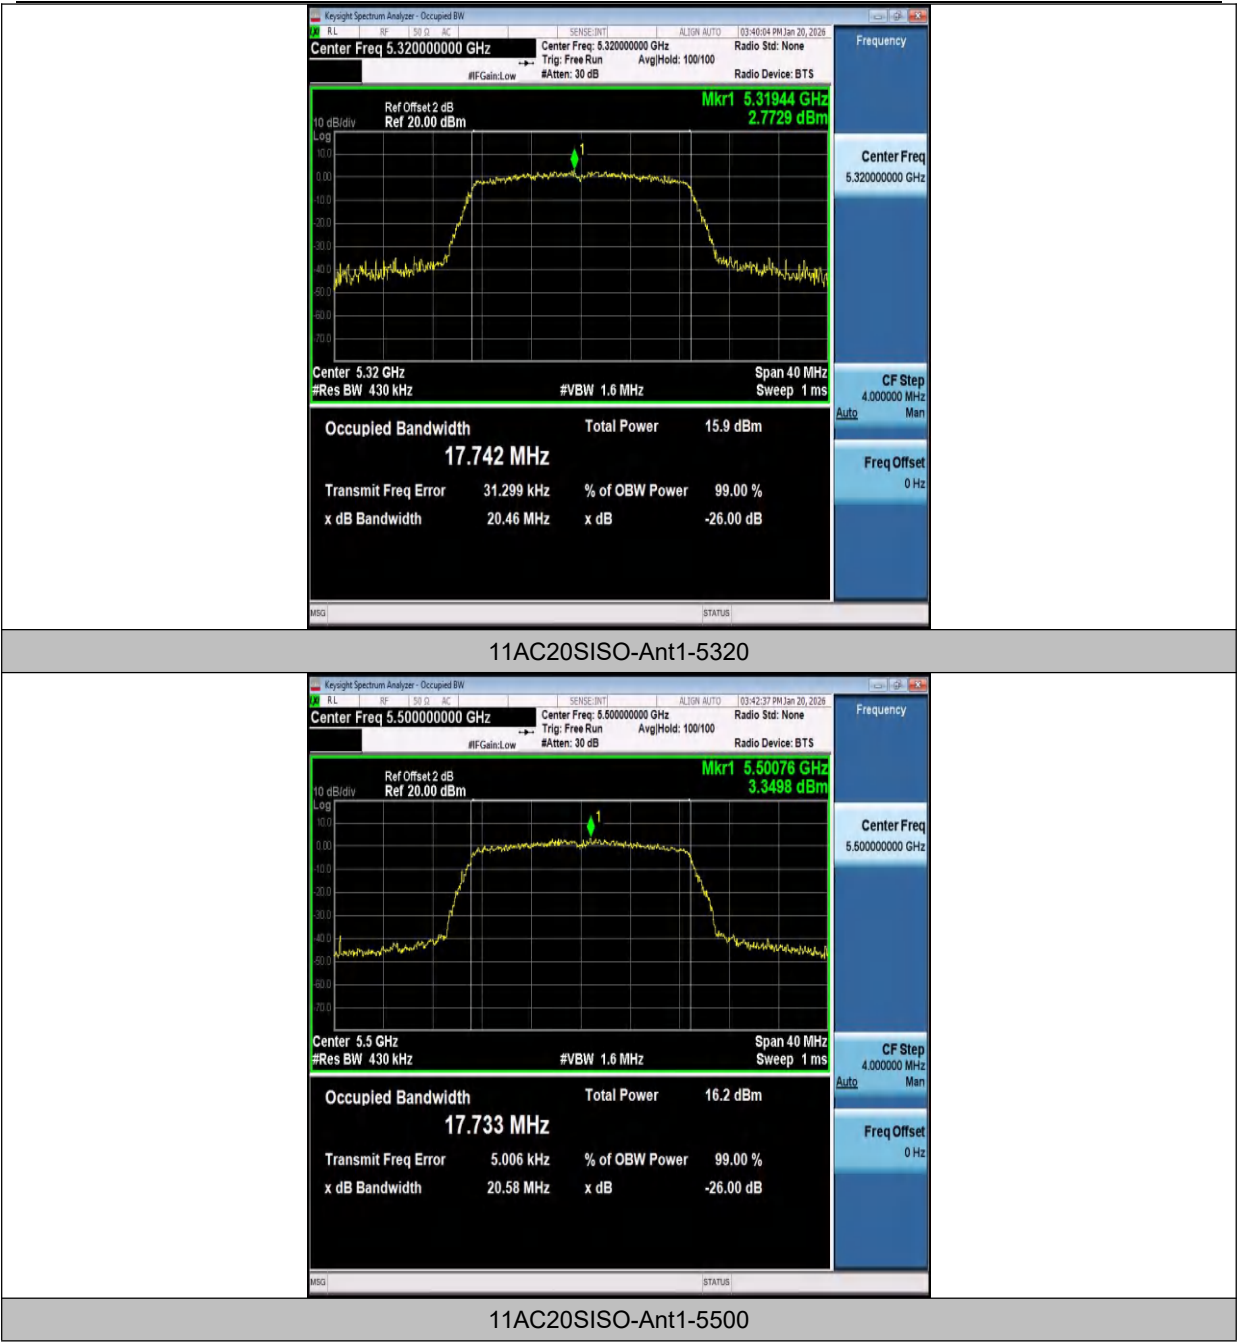

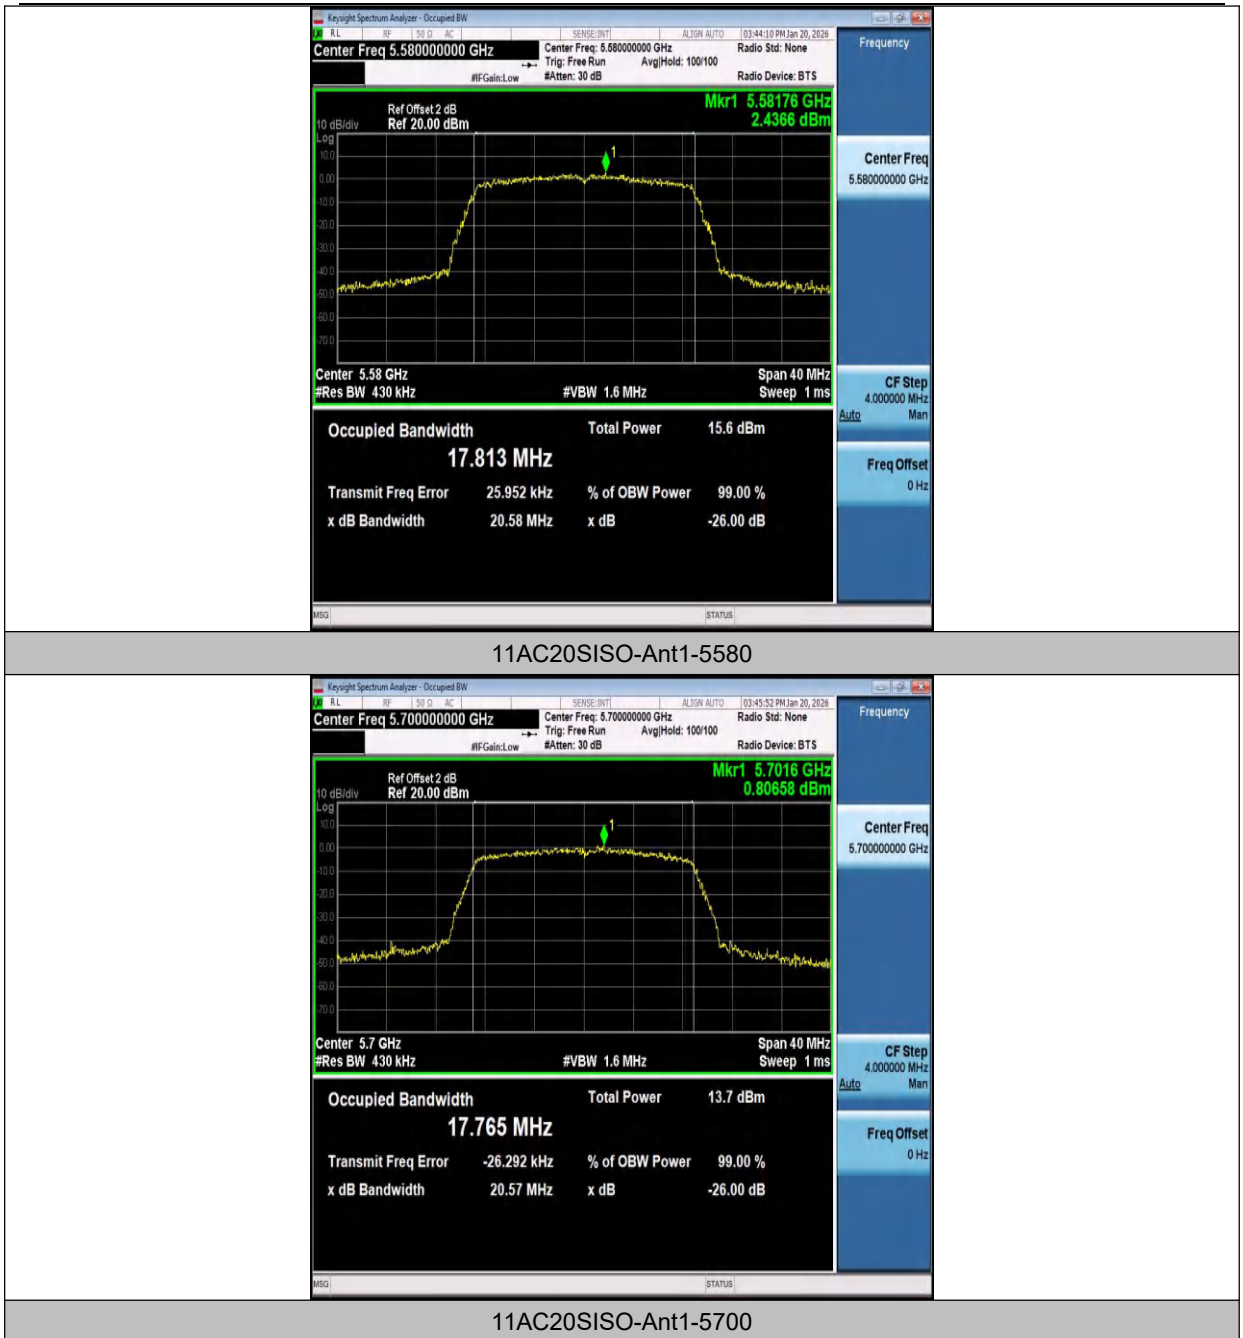

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

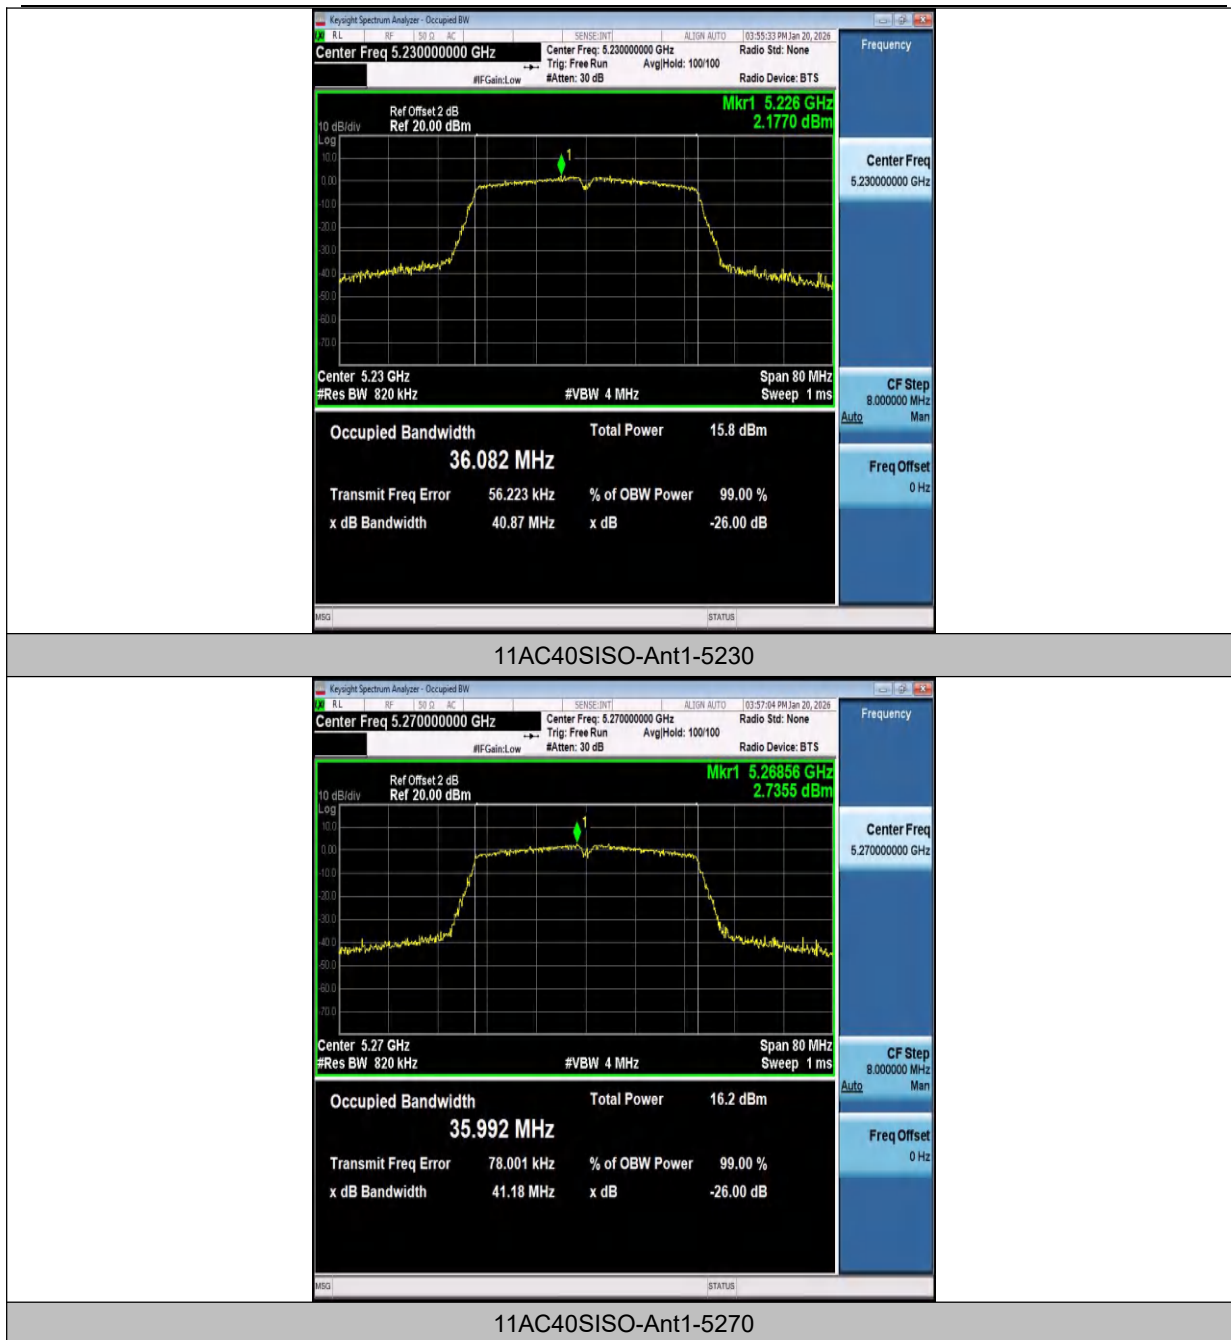

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

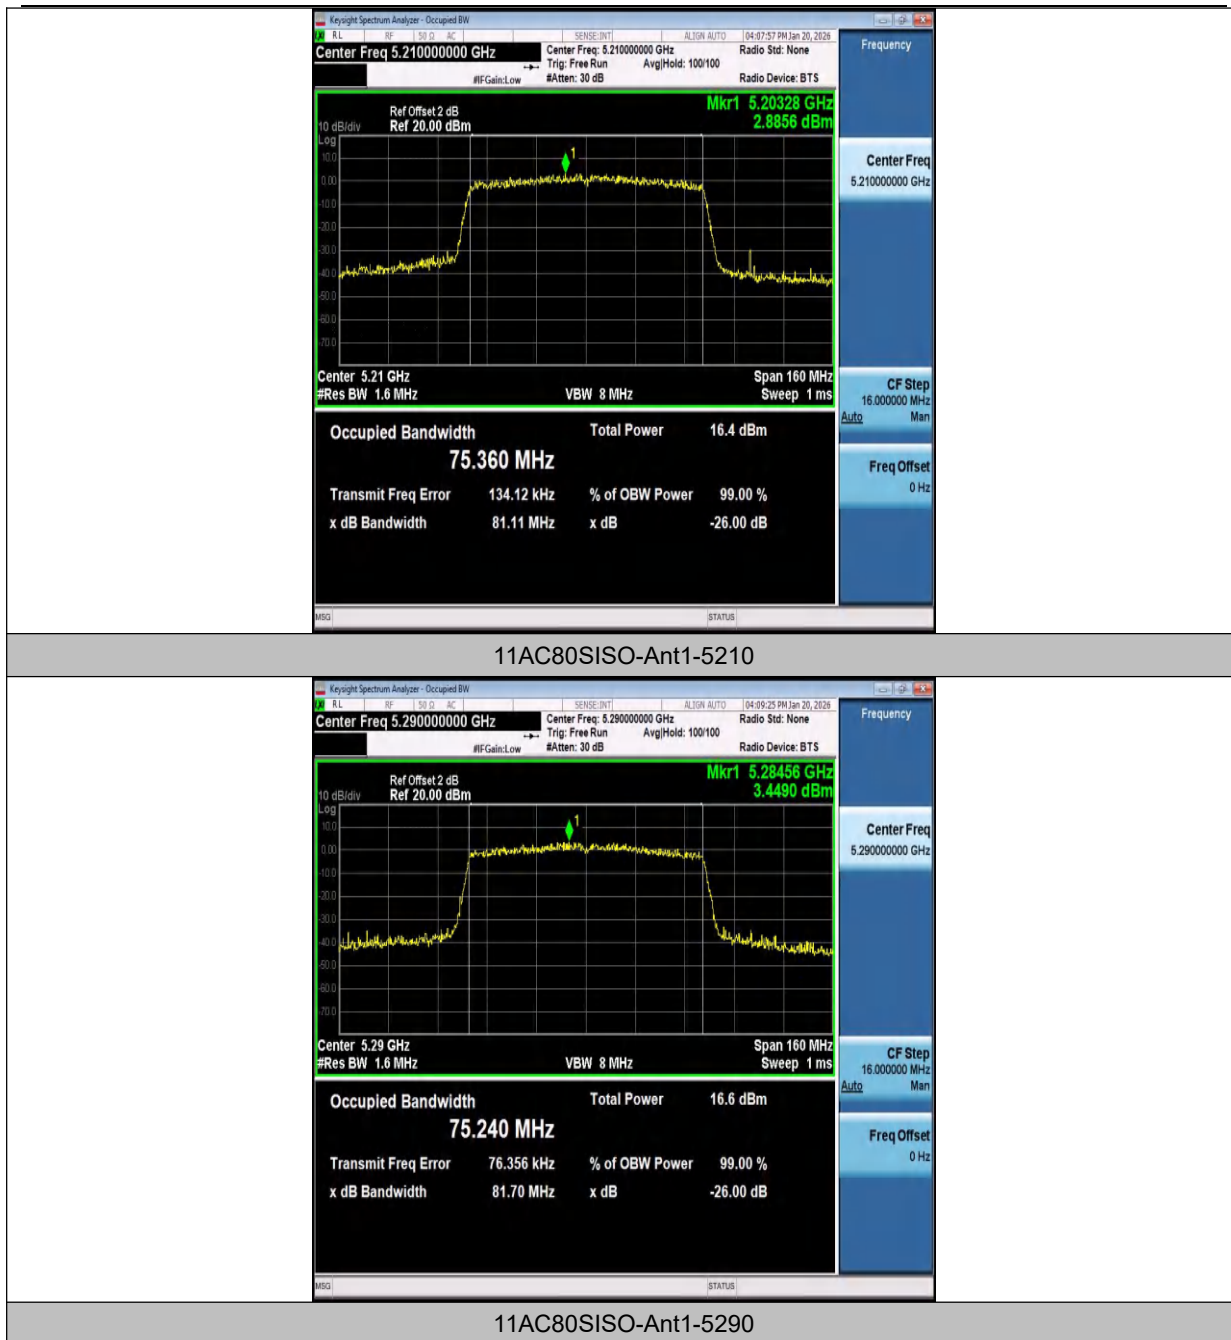

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

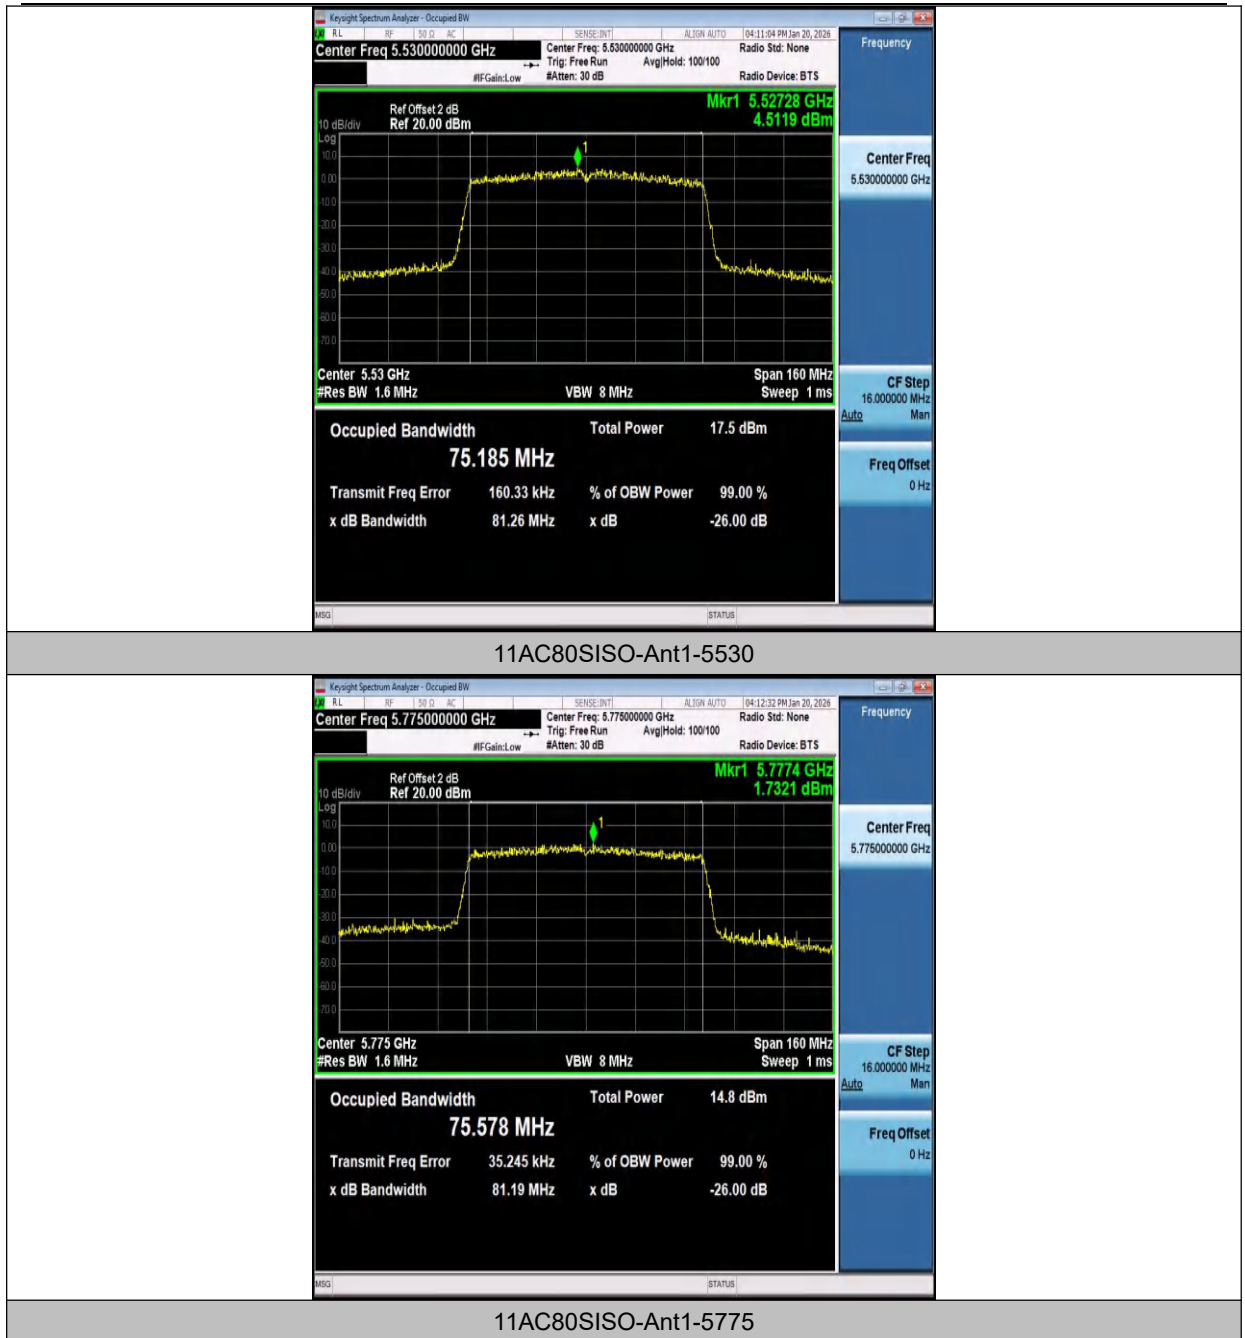

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix A3: Minimum 6dB Bandwidth

Test Result B4

Test Mode	Antenna	Frequency[MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	16.320	5736.840	5753.160	0.5	PASS
11A	Ant1	5785	16.360	5776.840	5793.200	0.5	PASS
11A	Ant1	5825	16.320	5816.840	5833.160	0.5	PASS
11N20SISO	Ant1	5745	17.600	5736.200	5753.800	0.5	PASS
11N20SISO	Ant1	5785	17.560	5776.240	5793.800	0.5	PASS
11N20SISO	Ant1	5825	17.560	5816.240	5833.800	0.5	PASS
11N40SISO	Ant1	5755	36.320	5736.840	5773.160	0.5	PASS
11N40SISO	Ant1	5795	36.080	5776.840	5812.920	0.5	PASS
11AC20SISO	Ant1	5745	17.520	5736.240	5753.760	0.5	PASS
11AC20SISO	Ant1	5785	17.600	5776.200	5793.800	0.5	PASS
11AC20SISO	Ant1	5825	17.600	5816.200	5833.800	0.5	PASS
11AC40SISO	Ant1	5755	36.080	5736.840	5772.920	0.5	PASS
11AC40SISO	Ant1	5795	36.320	5776.840	5813.160	0.5	PASS
11AC80SISO	Ant1	5775	76.160	5736.920	5813.080	0.5	PASS