

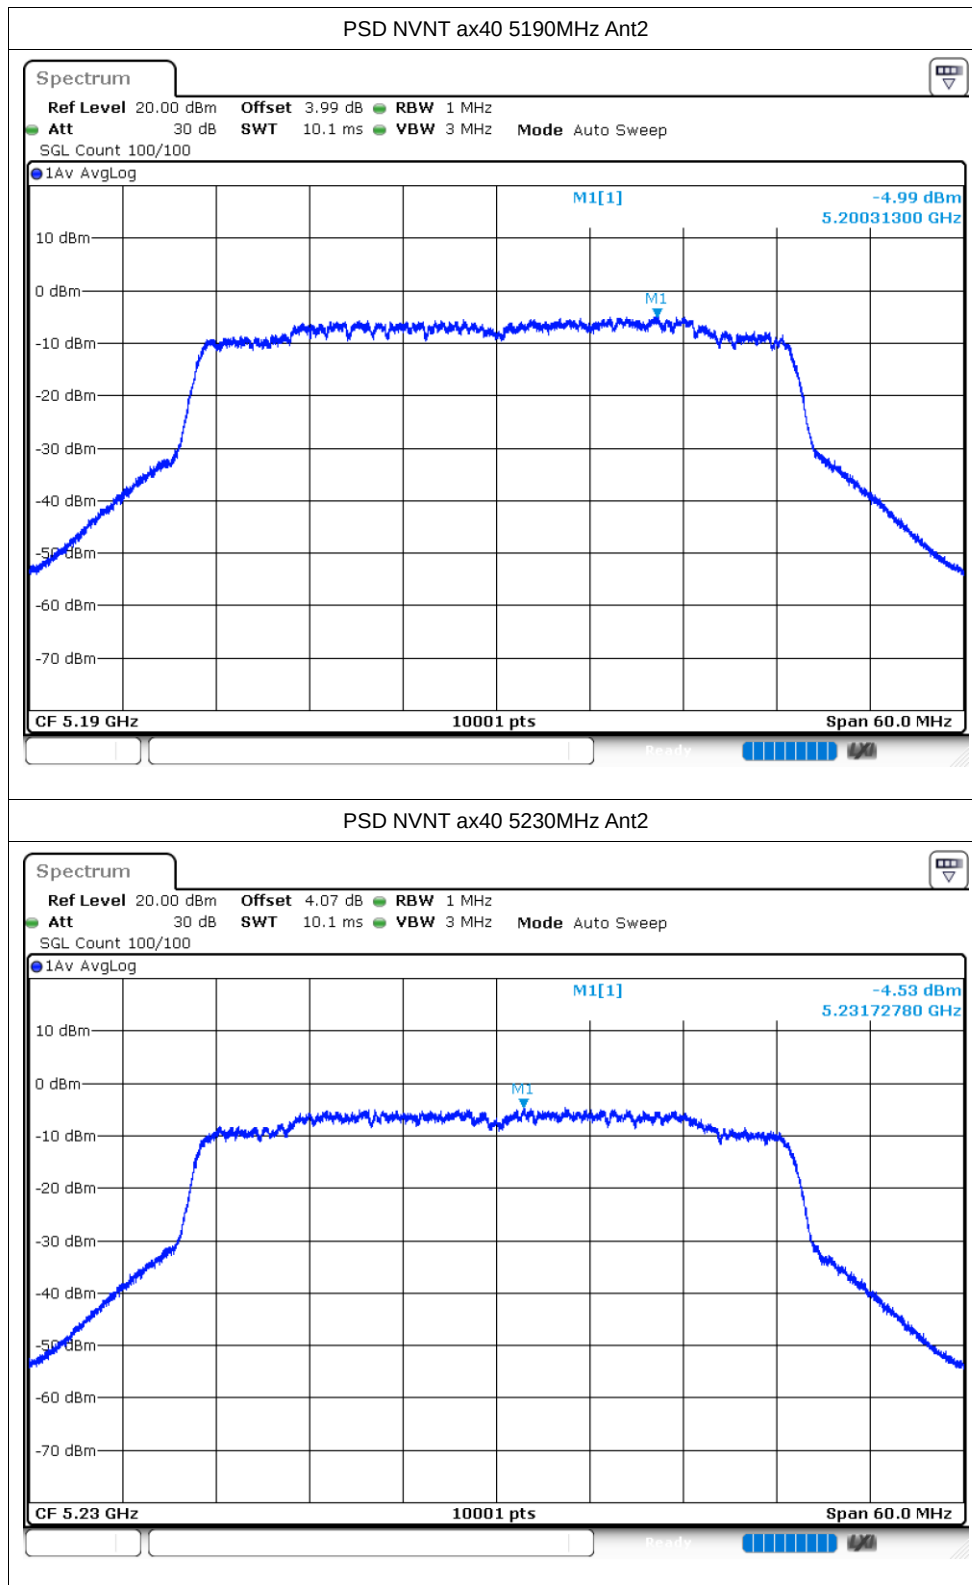


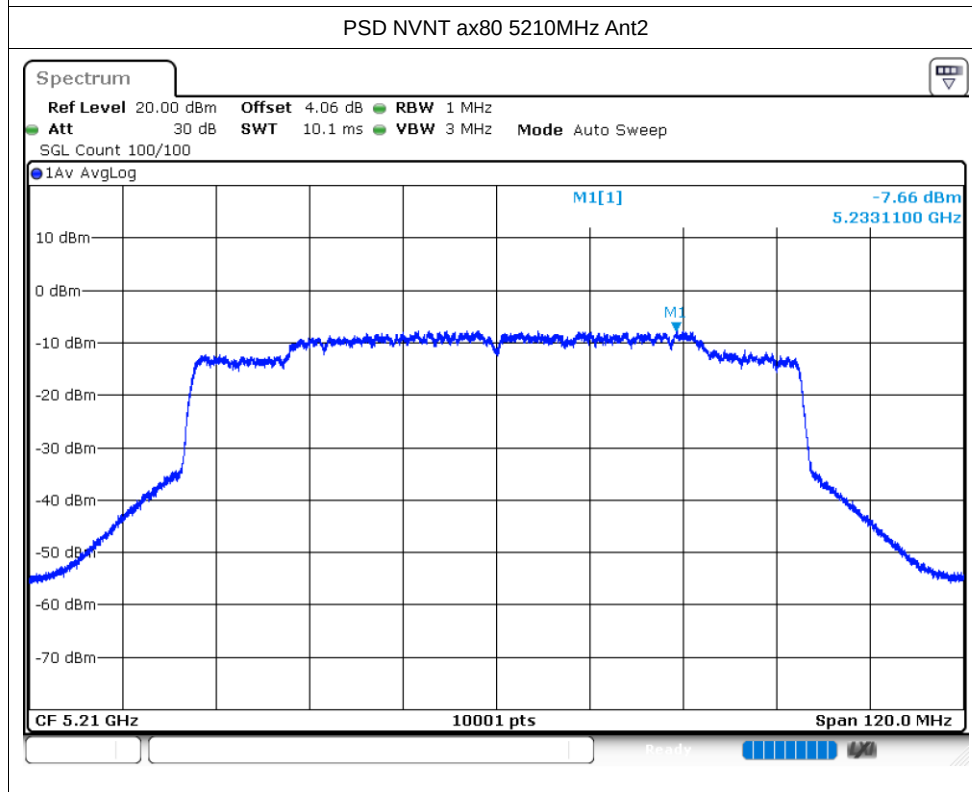

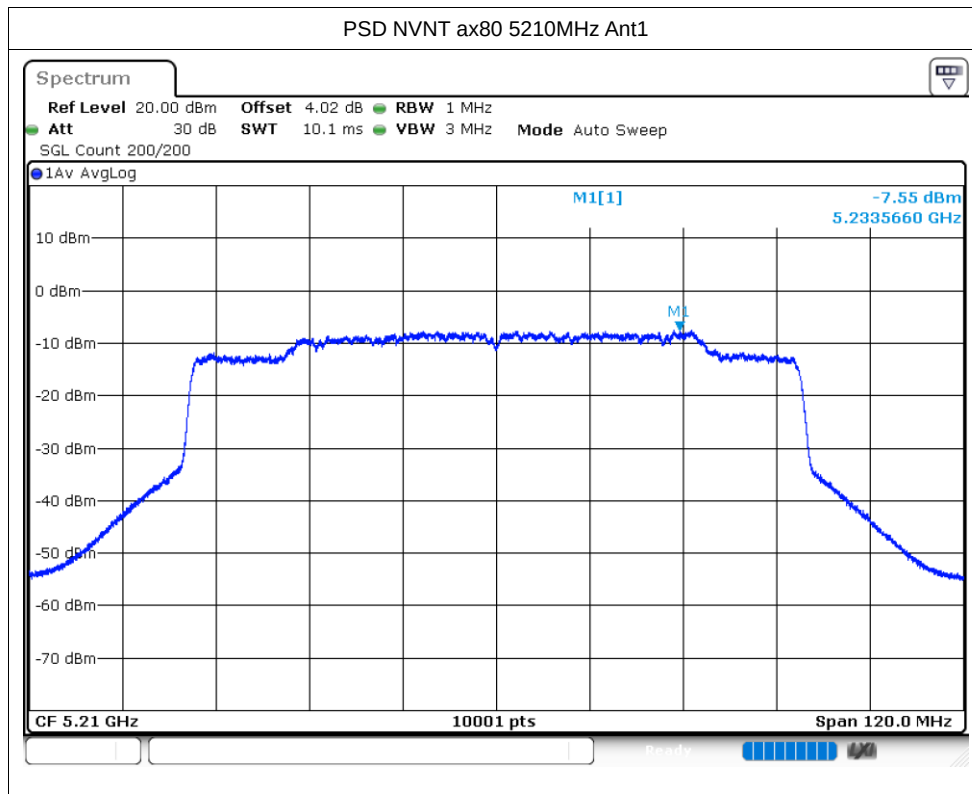


Band Edge


Condition	Mode	Frequency (MHz)	Antenna	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	a	5180	Ant1	-40.67	-27	Pass
NVNT	a	5240	Ant1	-41.05	-27	Pass
NVNT	a	5180	Ant2	-41.86	-27	Pass
NVNT	a	5240	Ant2	-42.22	-27	Pass
NVNT	n20	5180	Ant1	-42.05	-27	Pass
NVNT	n20	5240	Ant1	-41.57	-27	Pass
NVNT	n20	5180	Ant2	-41.97	-27	Pass
NVNT	n20	5240	Ant2	-41.89	-27	Pass
NVNT	n40	5190	Ant1	-44.02	-27	Pass
NVNT	n40	5230	Ant1	-45.22	-27	Pass
NVNT	n40	5190	Ant2	-42.19	-27	Pass
NVNT	n40	5230	Ant2	-42.14	-27	Pass
NVNT	ac20	5180	Ant1	-35.66	-27	Pass
NVNT	ac20	5240	Ant1	-40.96	-27	Pass
NVNT	ac20	5180	Ant2	-41.8	-27	Pass
NVNT	ac20	5240	Ant2	-42.13	-27	Pass
NVNT	ac40	5190	Ant1	-44.25	-27	Pass
NVNT	ac40	5230	Ant1	-45.29	-27	Pass
NVNT	ac40	5190	Ant2	-42.44	-27	Pass
NVNT	ac40	5230	Ant2	-42.03	-27	Pass
NVNT	ac80	5210	Ant1	-41.52	-27	Pass
NVNT	ac80	5210	Ant2	-41.71	-27	Pass
NVNT	ax20	5180	Ant1	-41.08	-27	Pass
NVNT	ax20	5240	Ant1	-41.22	-27	Pass
NVNT	ax20	5180	Ant2	-41.99	-27	Pass
NVNT	ax20	5240	Ant2	-41.69	-27	Pass
NVNT	ax40	5190	Ant1	-40.98	-27	Pass
NVNT	ax40	5230	Ant1	-40.67	-27	Pass
NVNT	ax40	5190	Ant2	-41.9	-27	Pass
NVNT	ax40	5230	Ant2	-42.59	-27	Pass
NVNT	ax80	5210	Ant1	-41.28	-27	Pass
NVNT	ax80	5210	Ant2	-42.16	-27	Pass


Test Graphs


Band Edge NVNT a 5180MHz Low Ant1

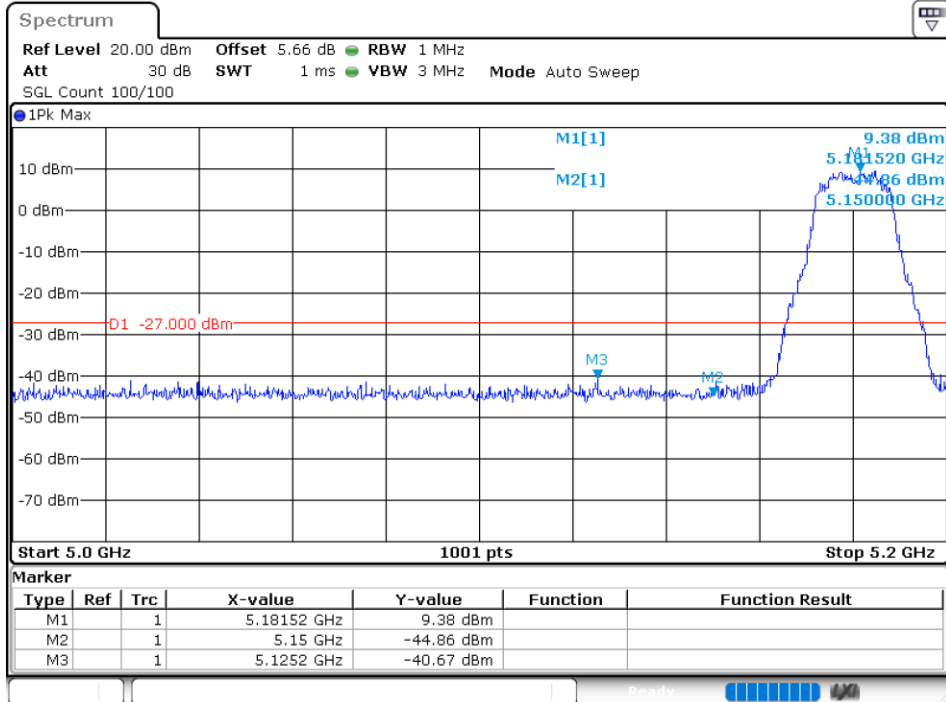



Band Edge NVNT a 5240MHz High Ant1

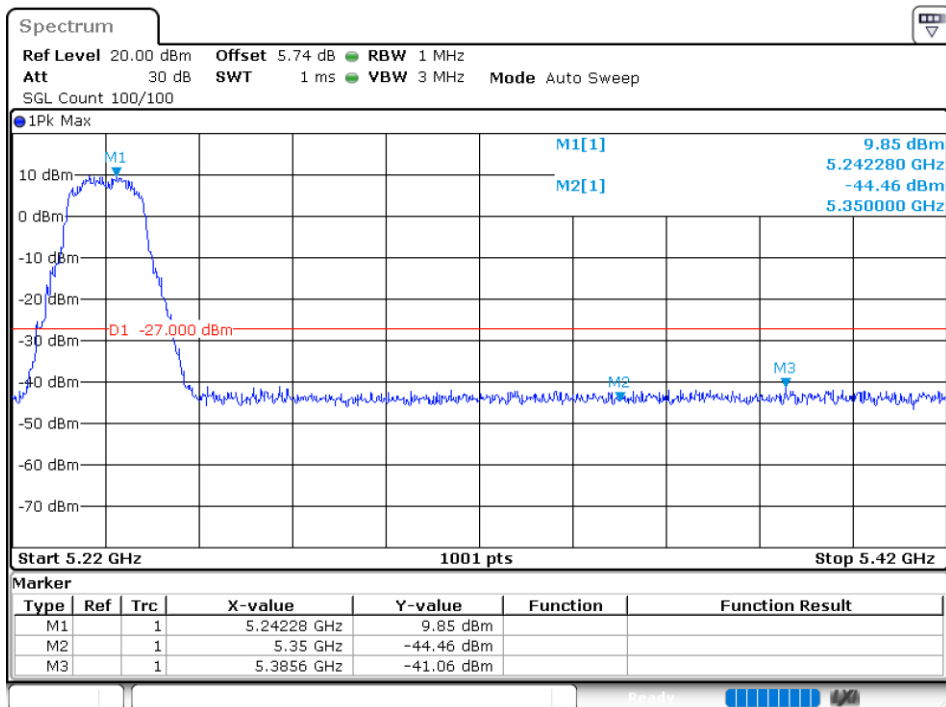


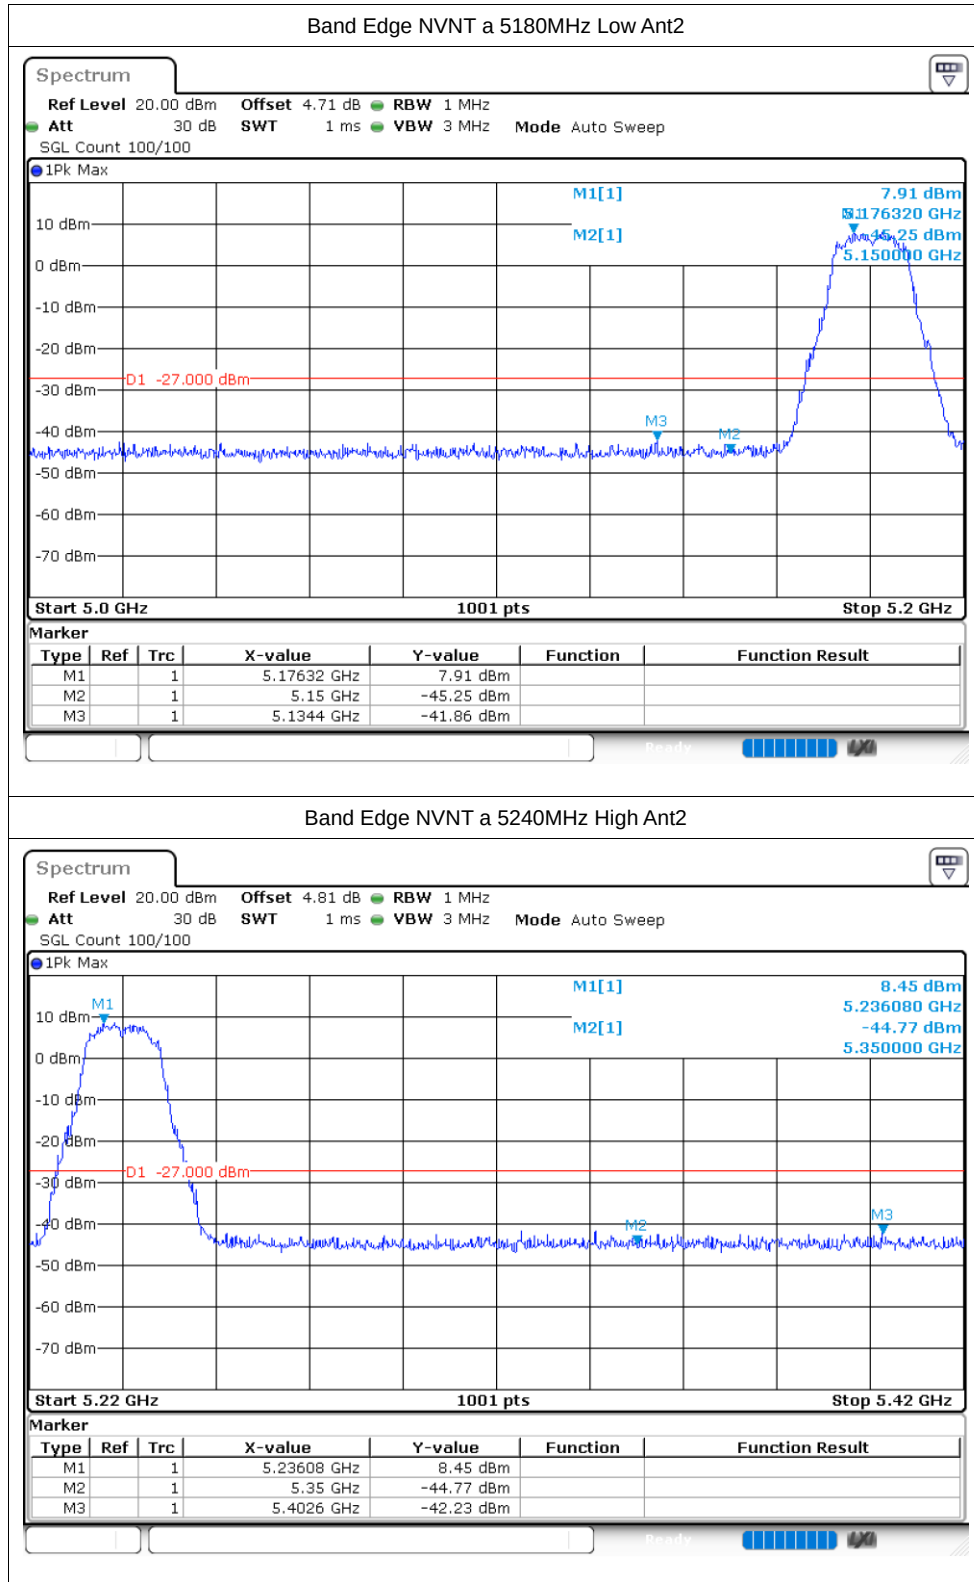


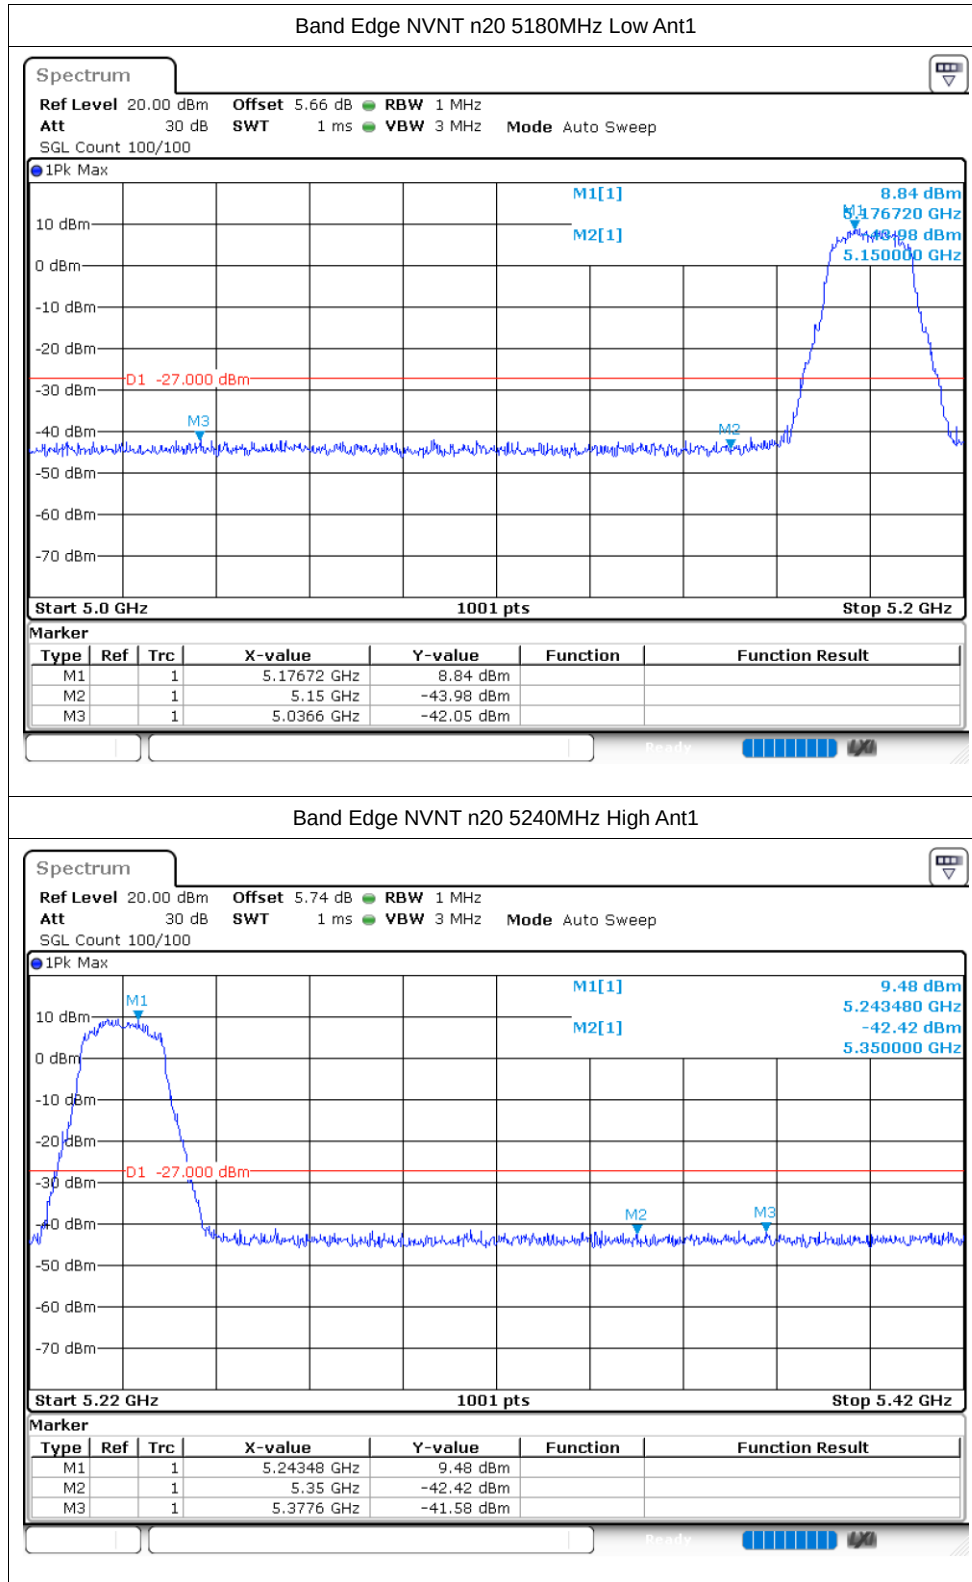


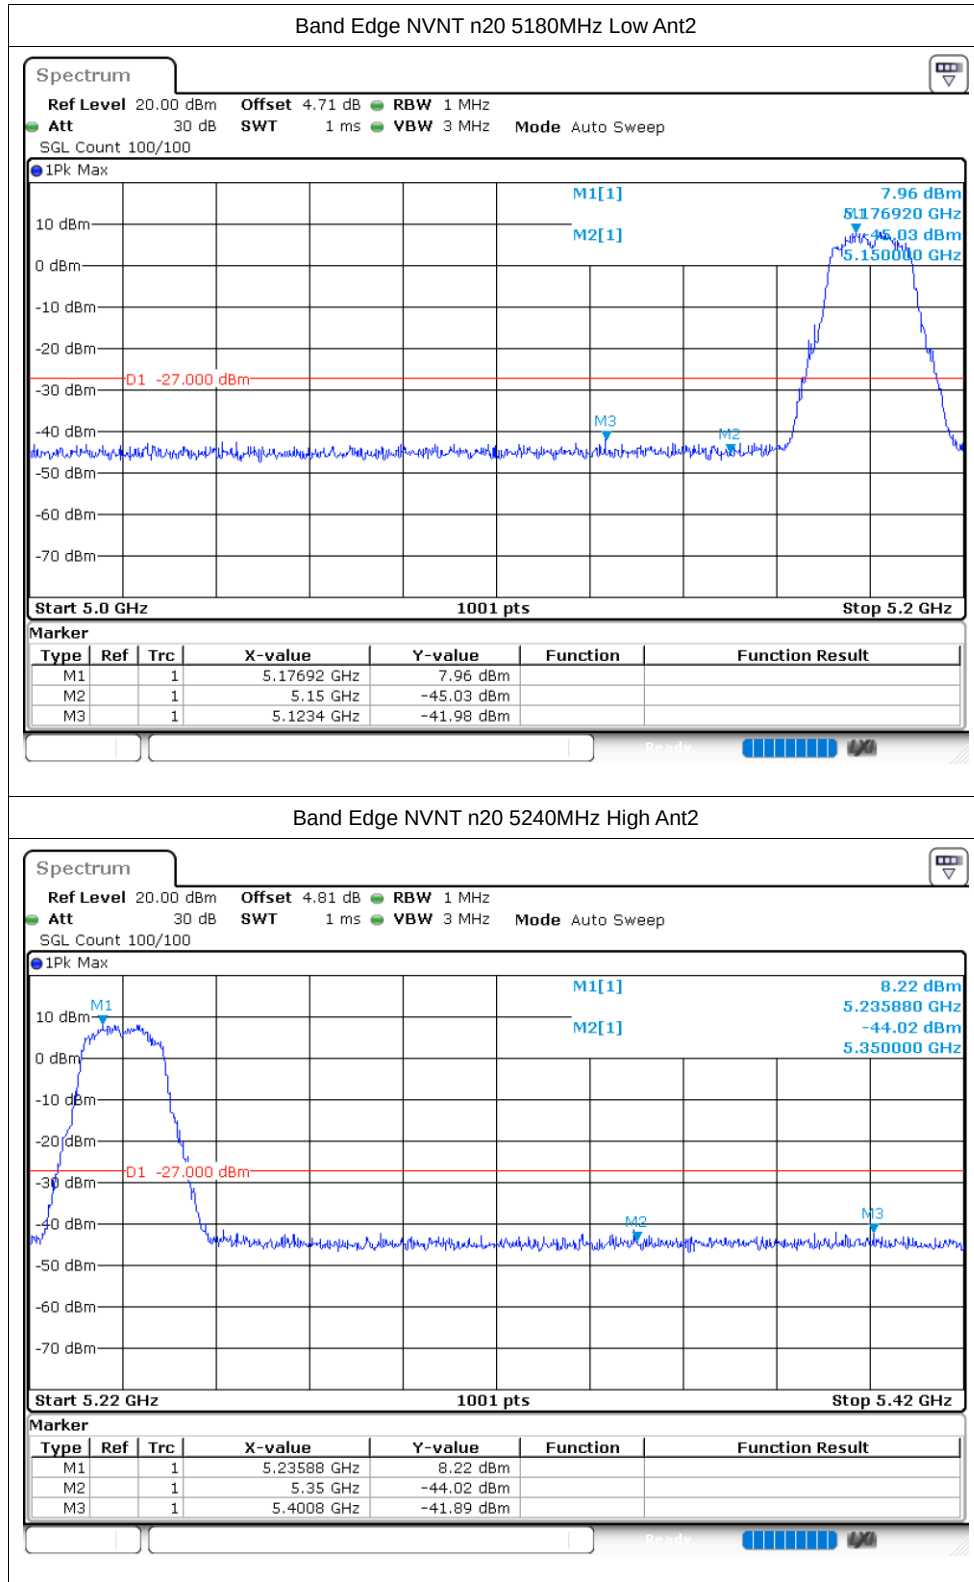


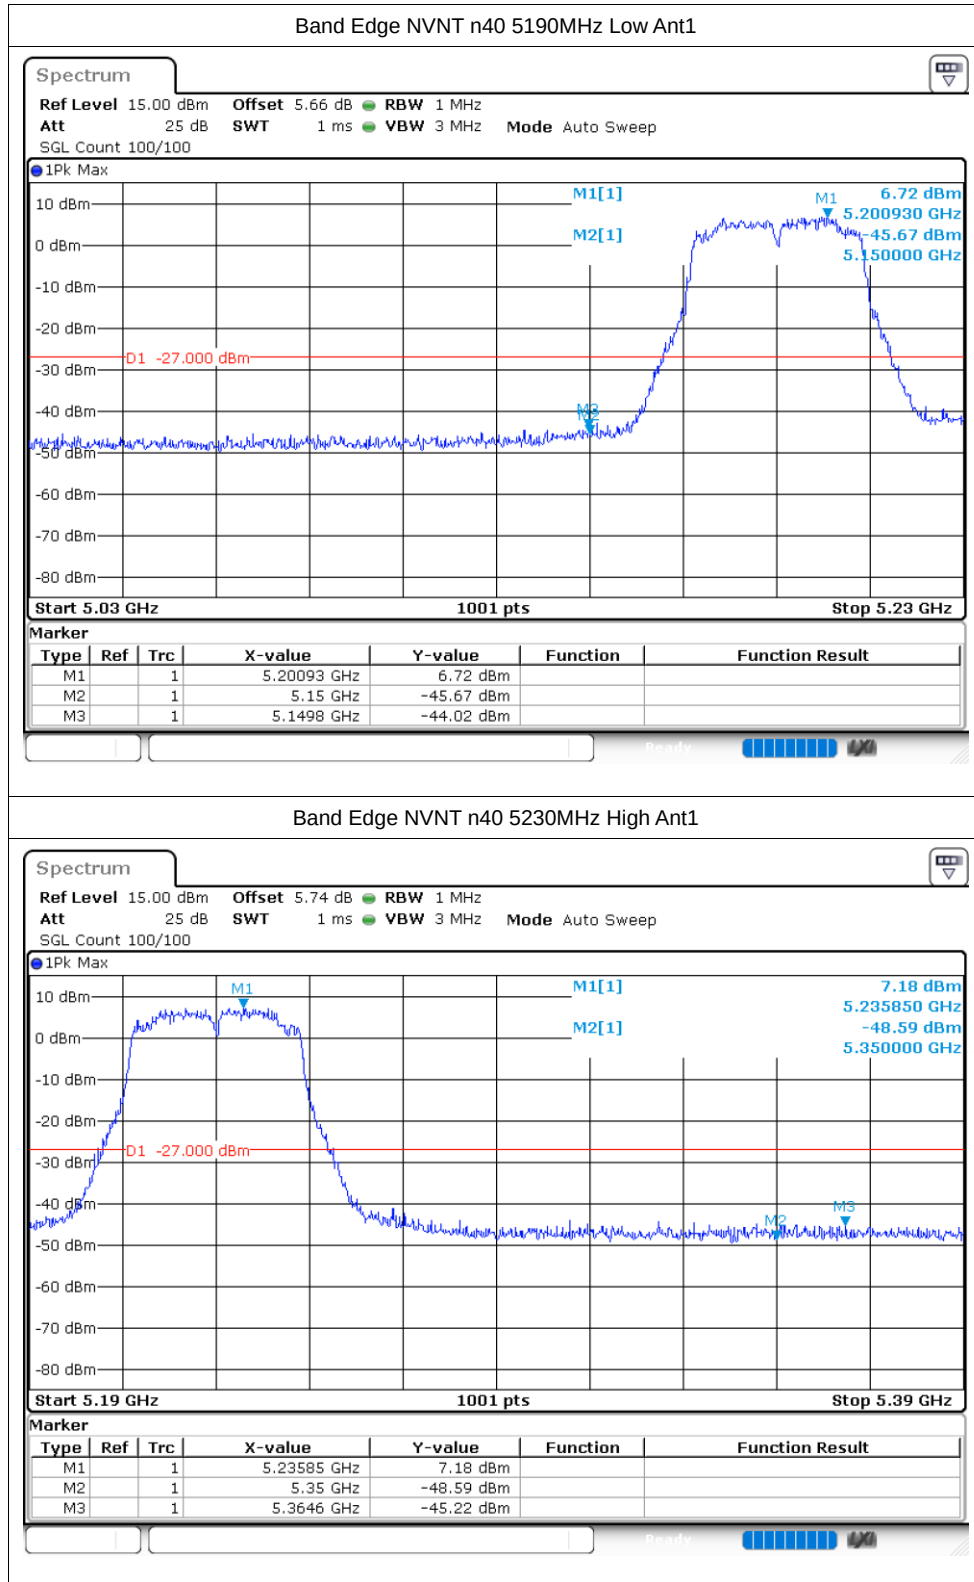


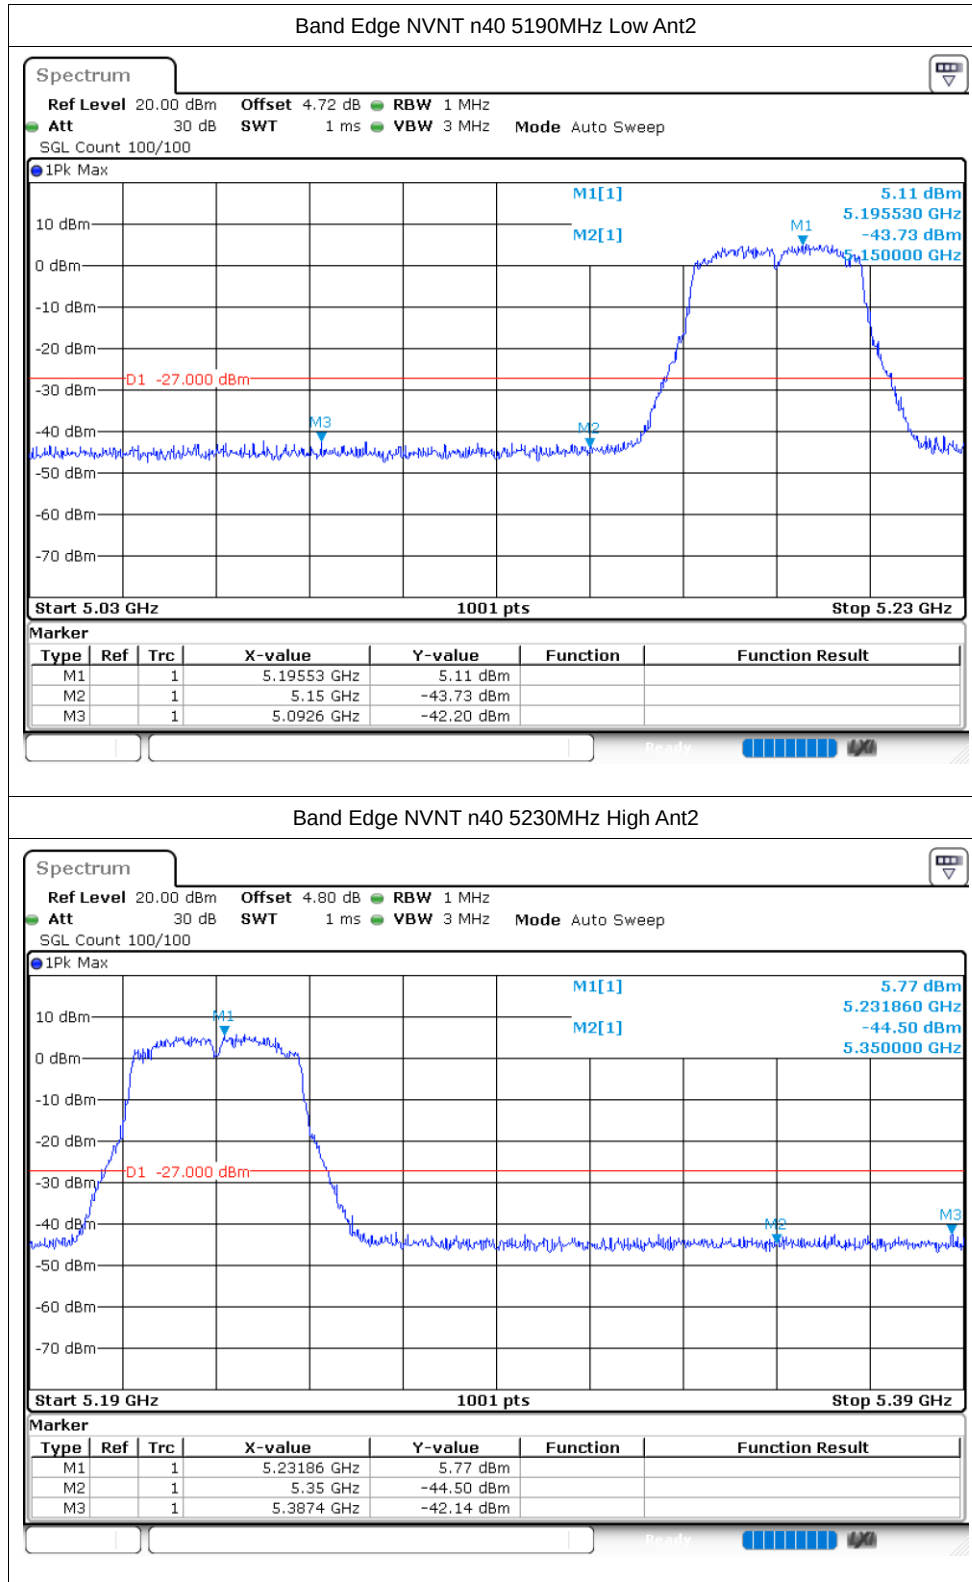


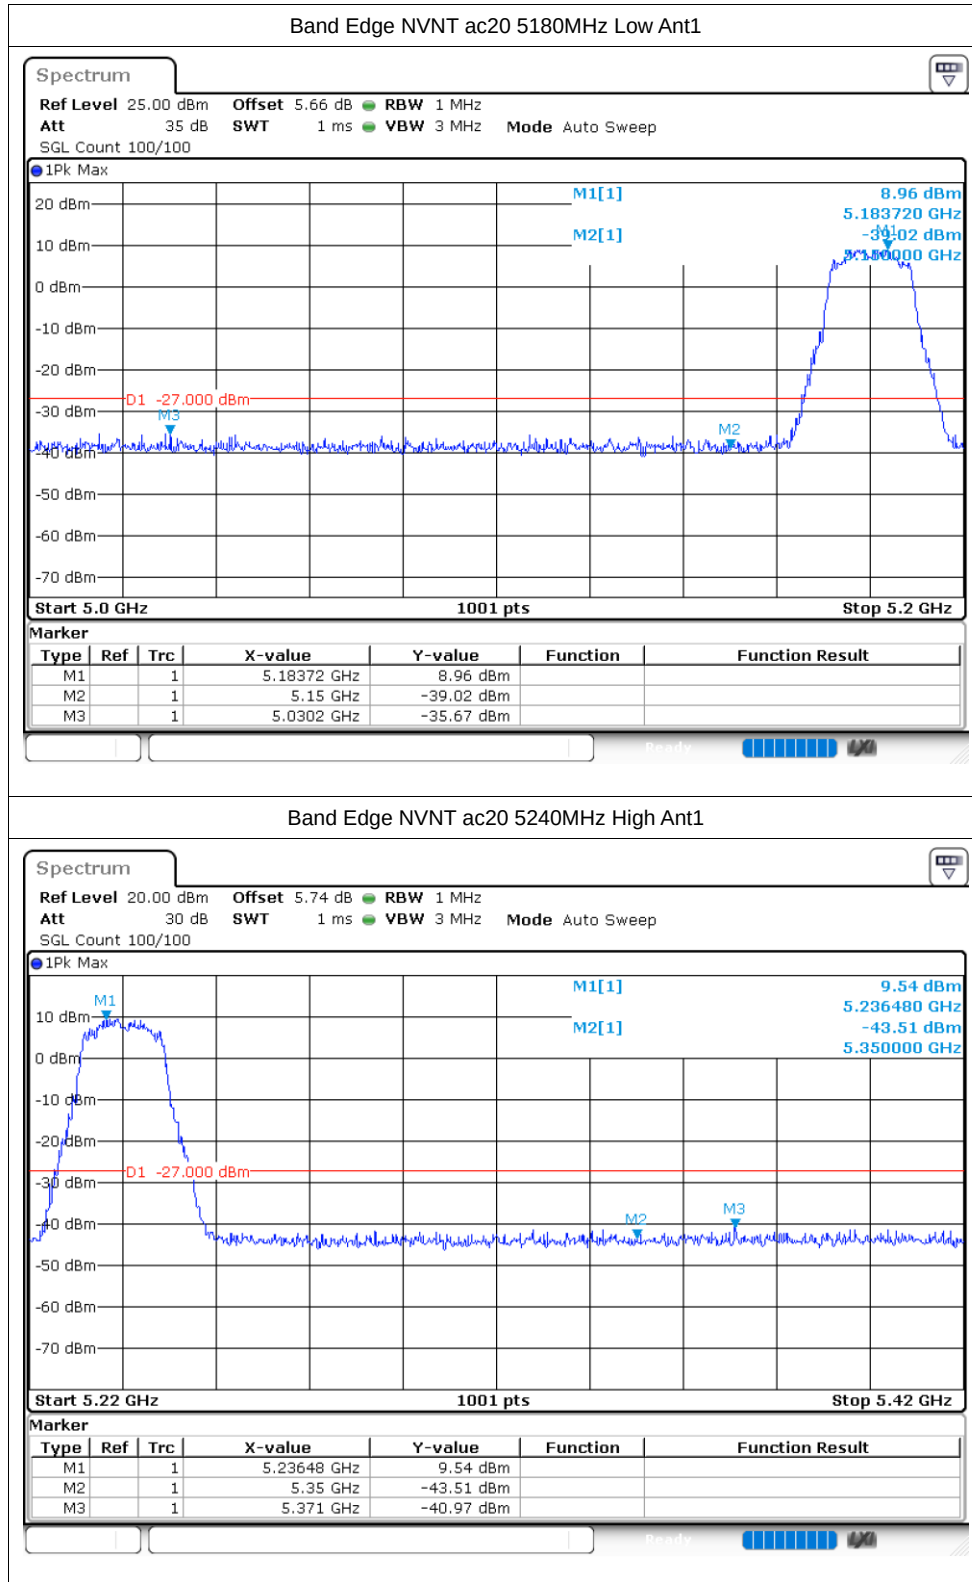


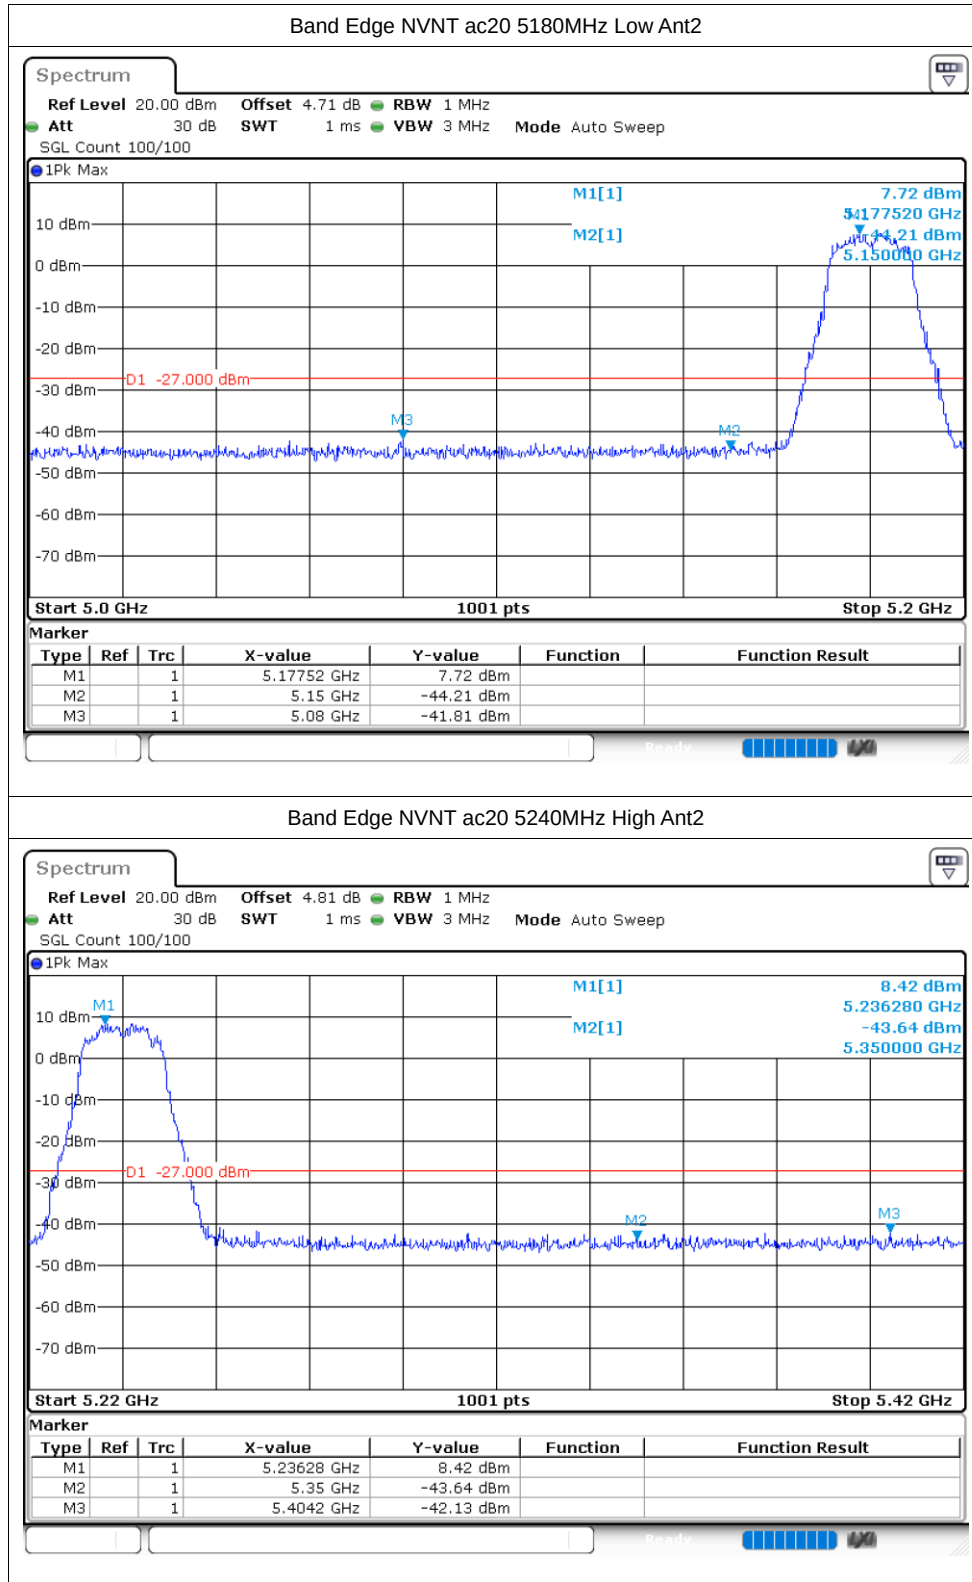


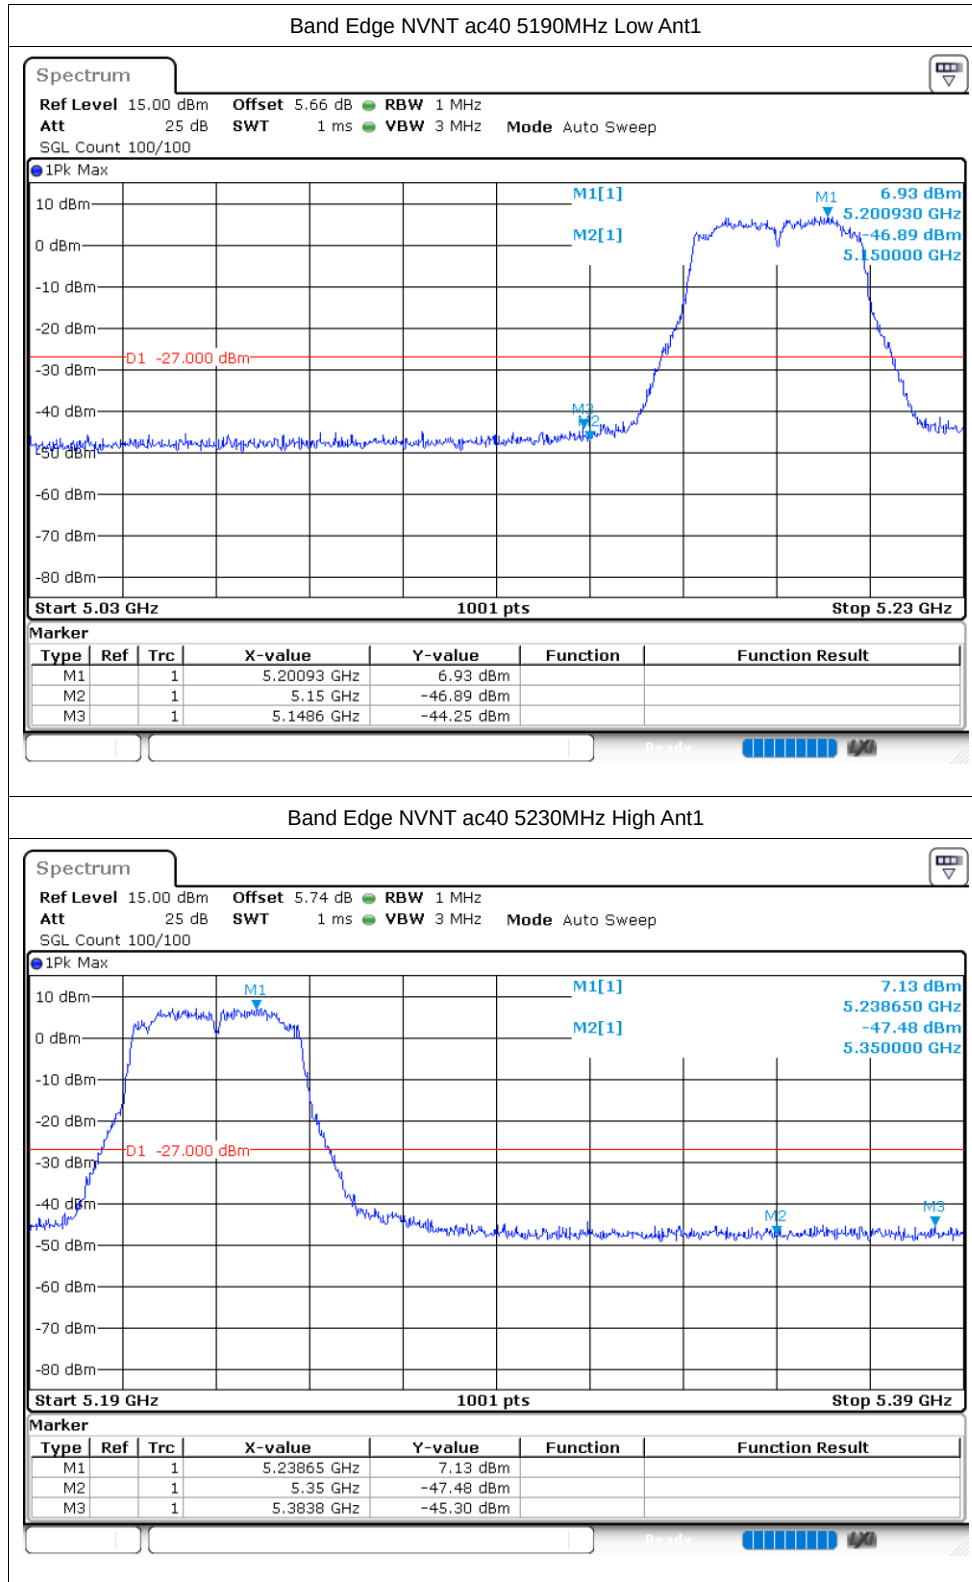


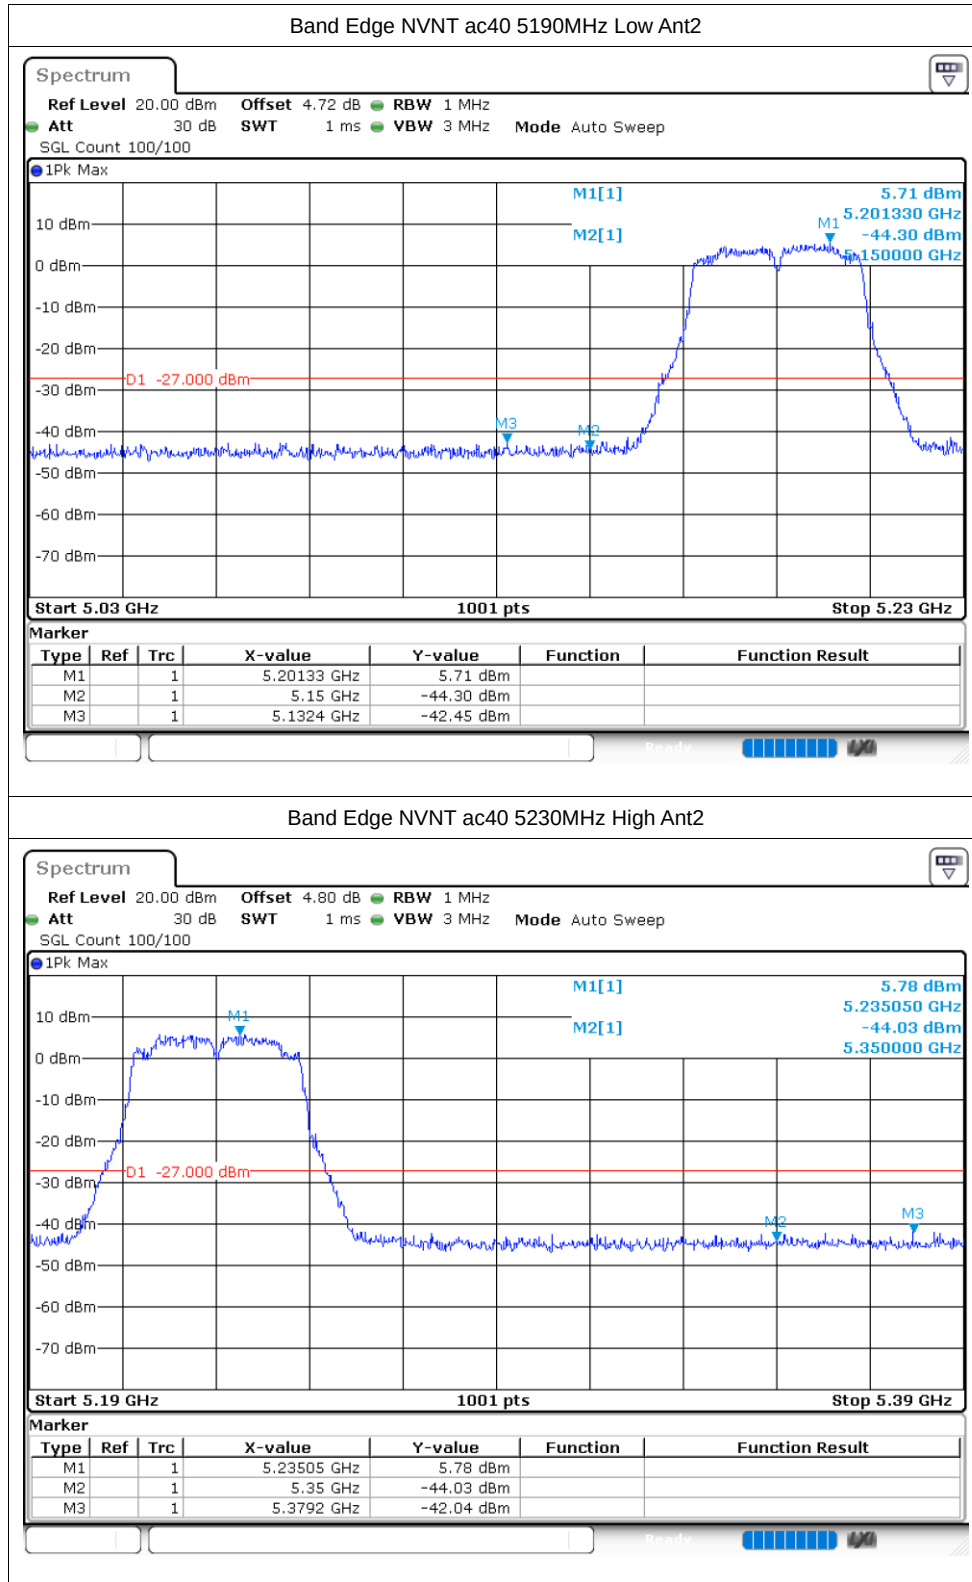


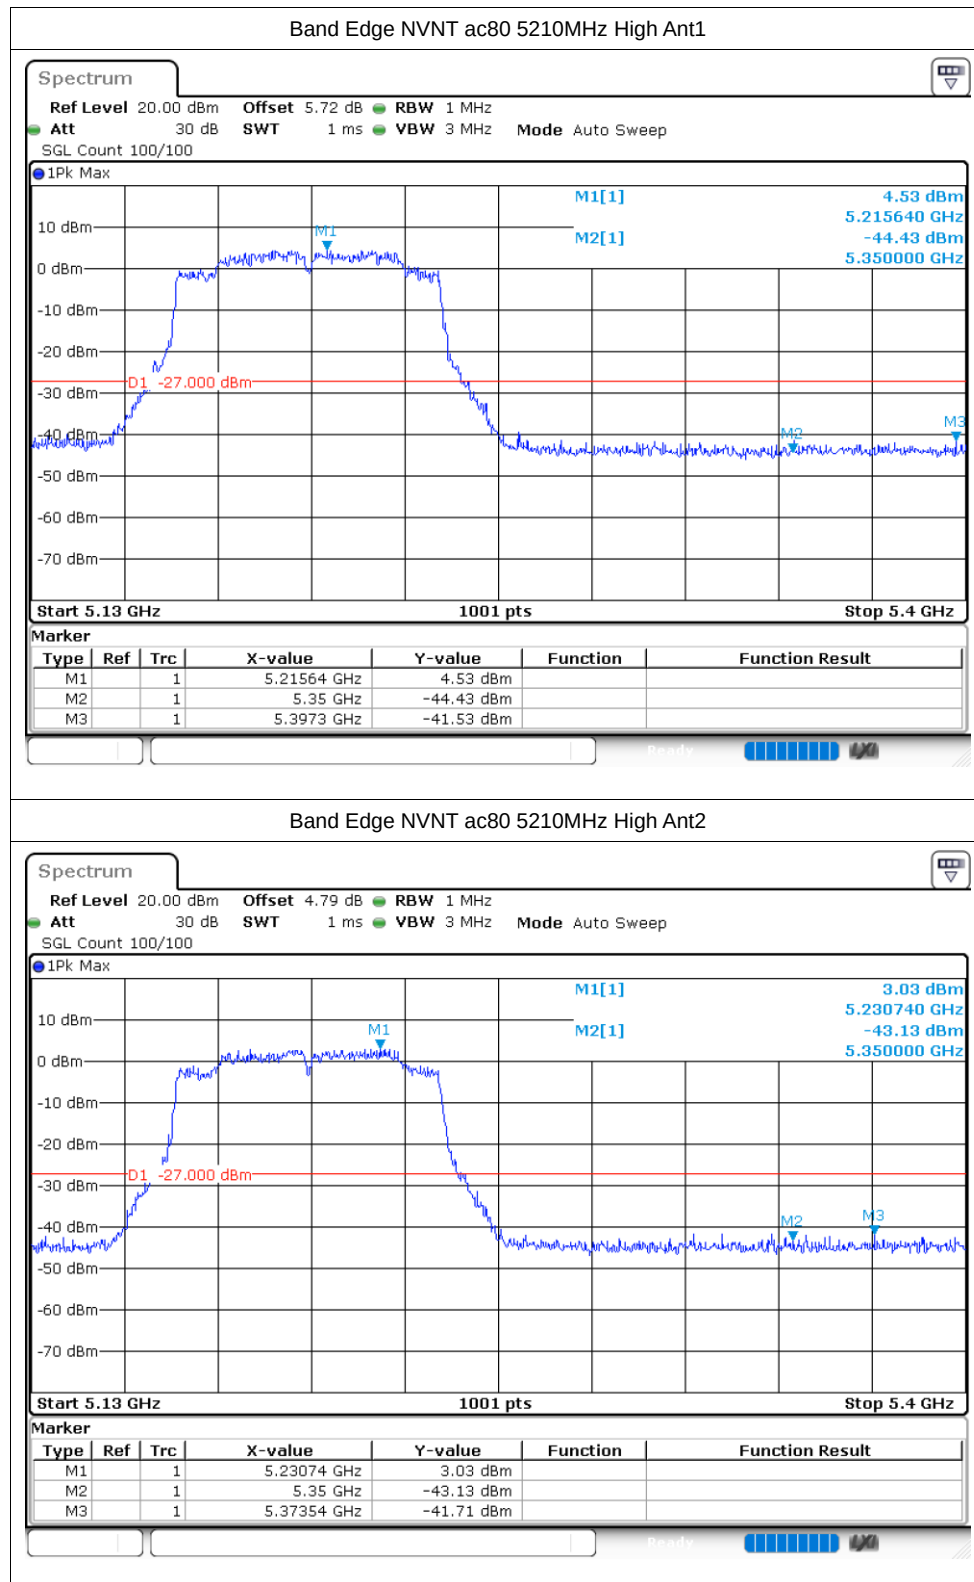


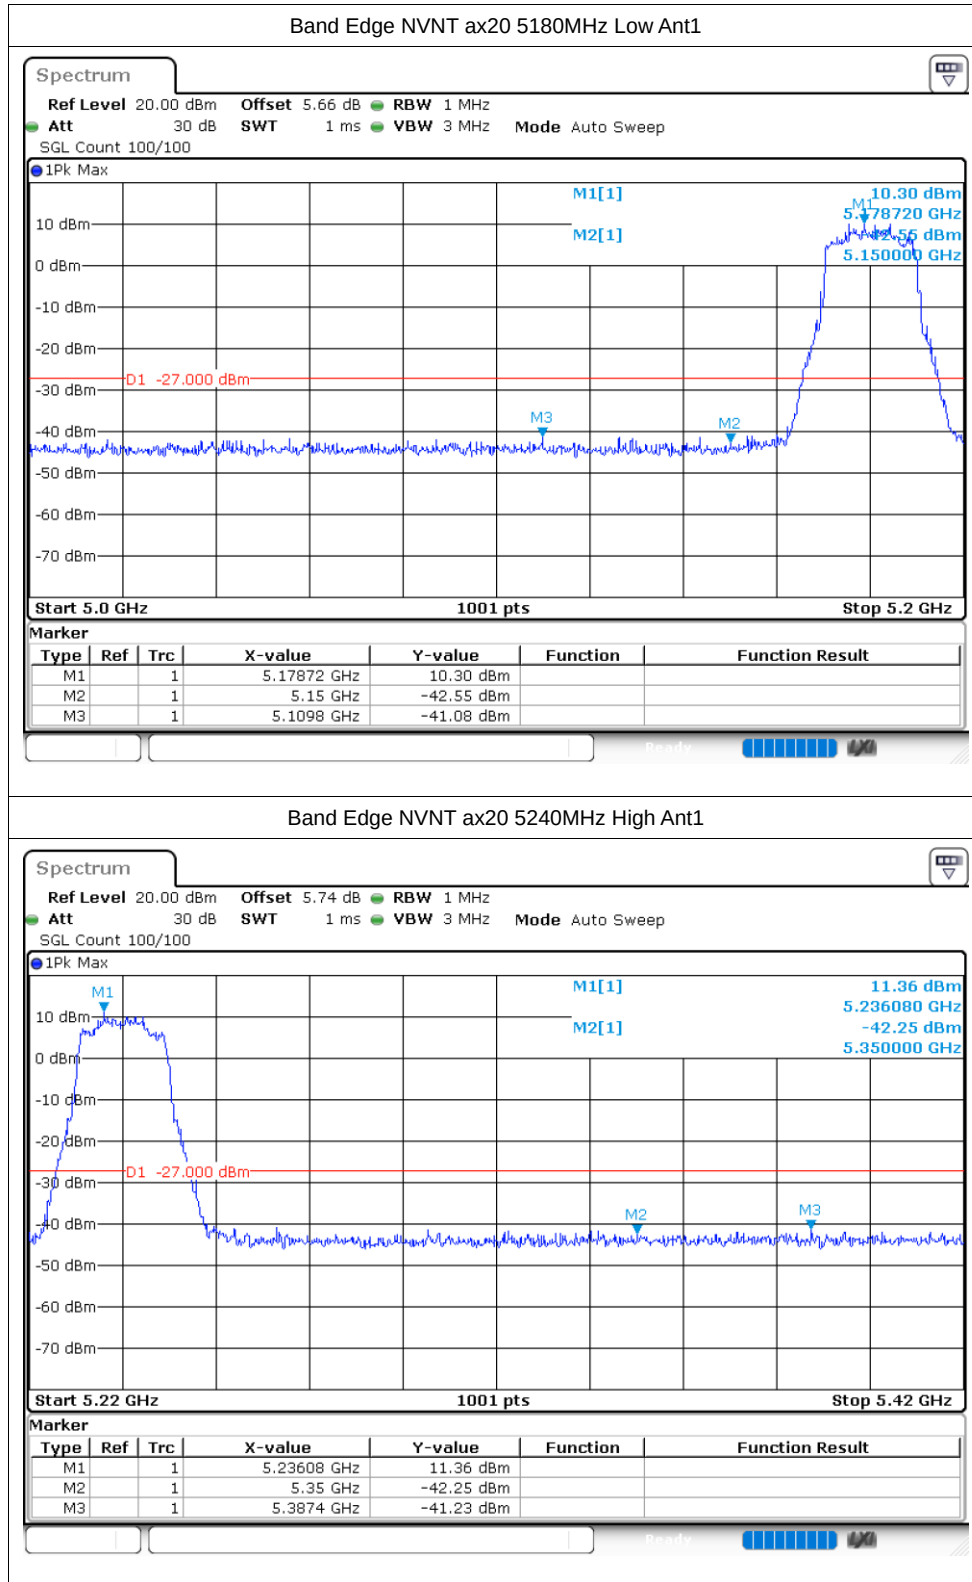

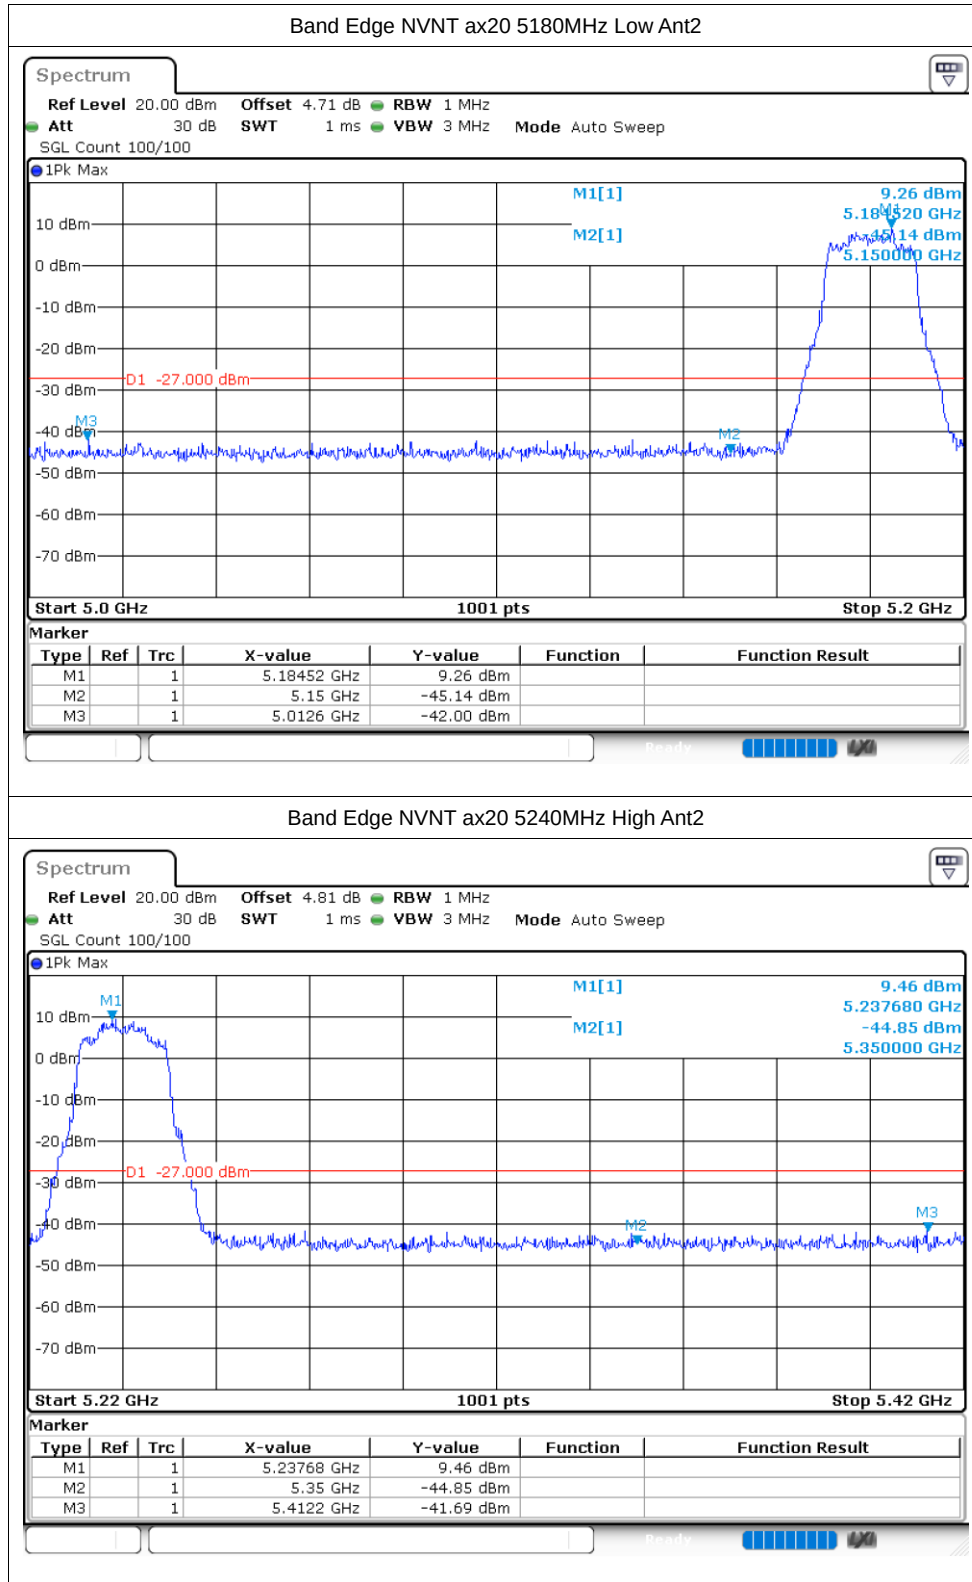

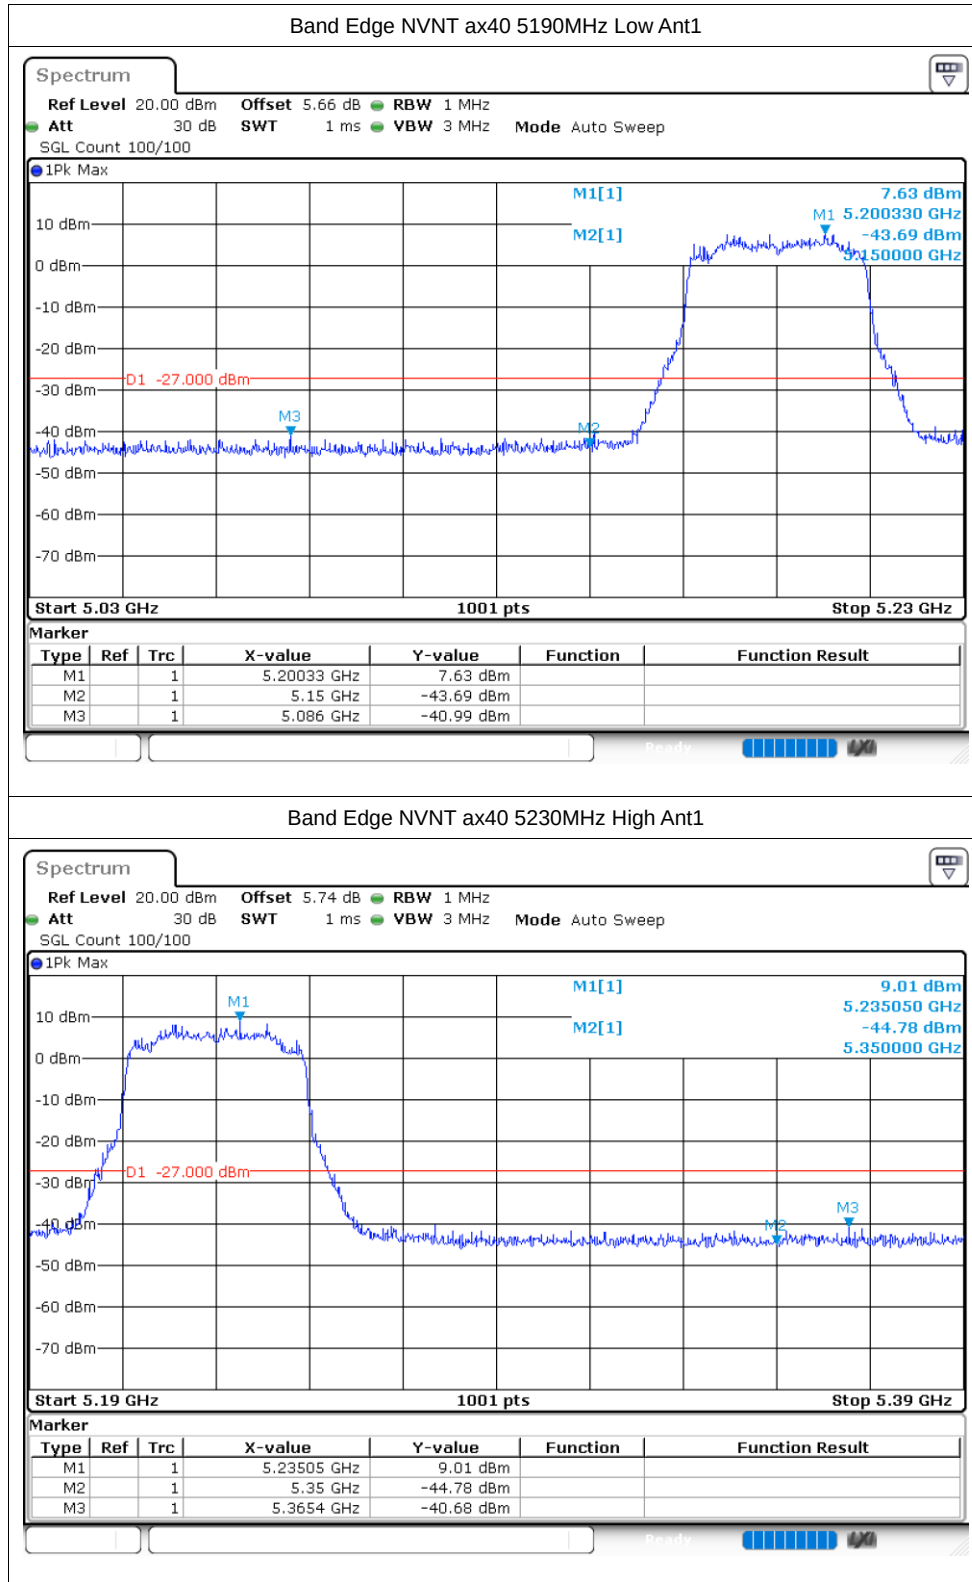

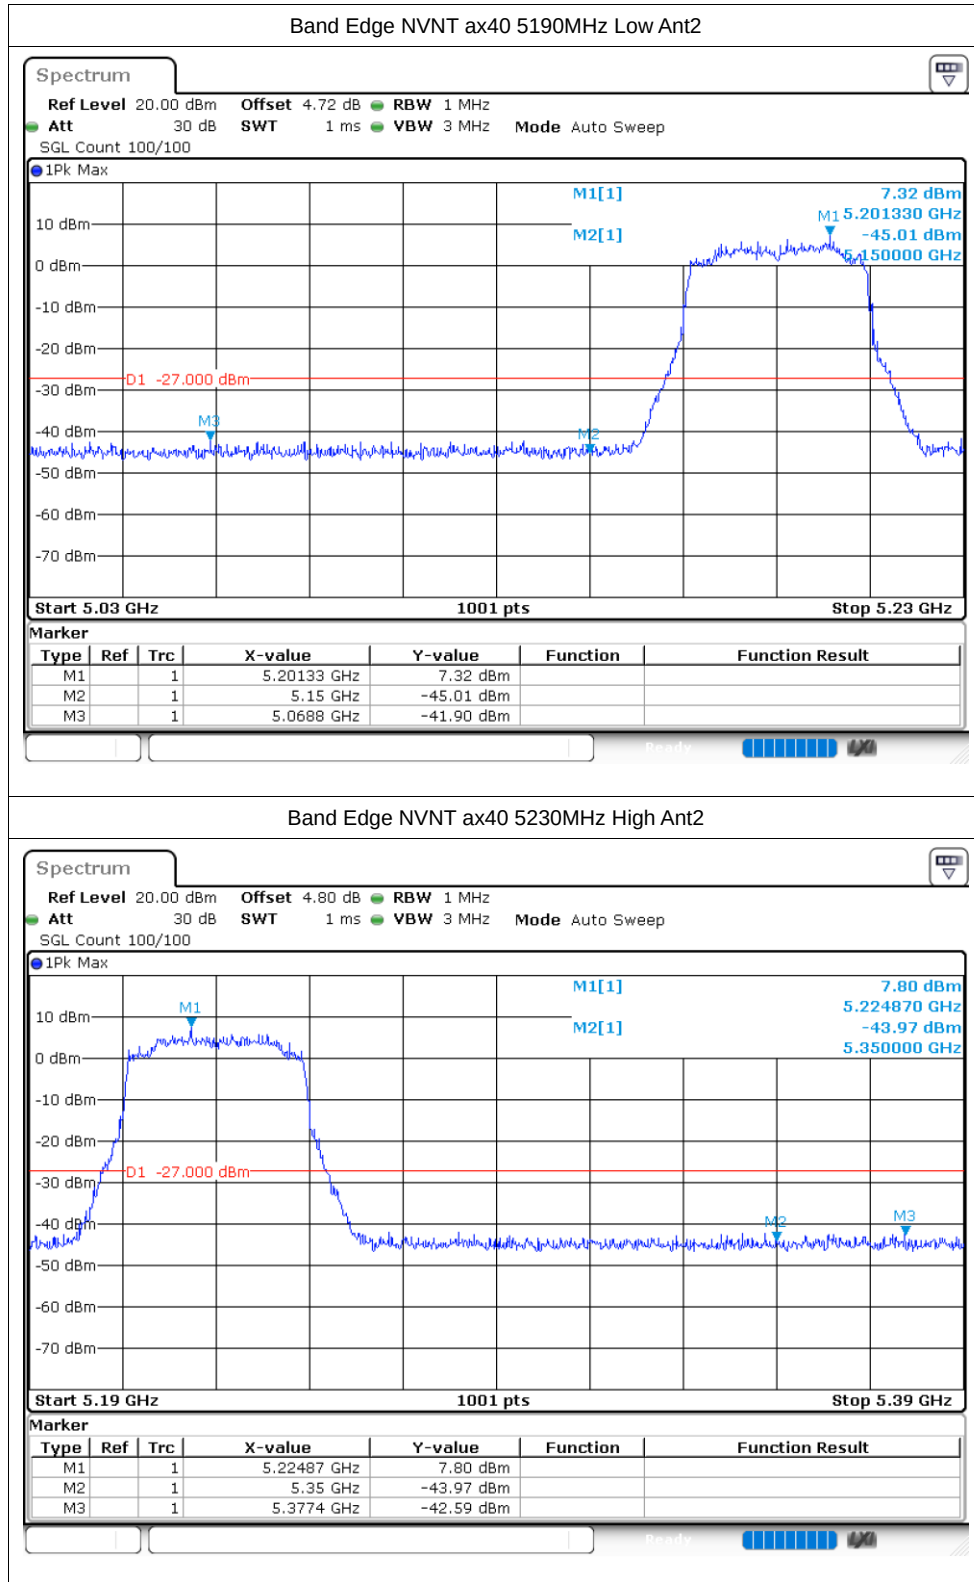

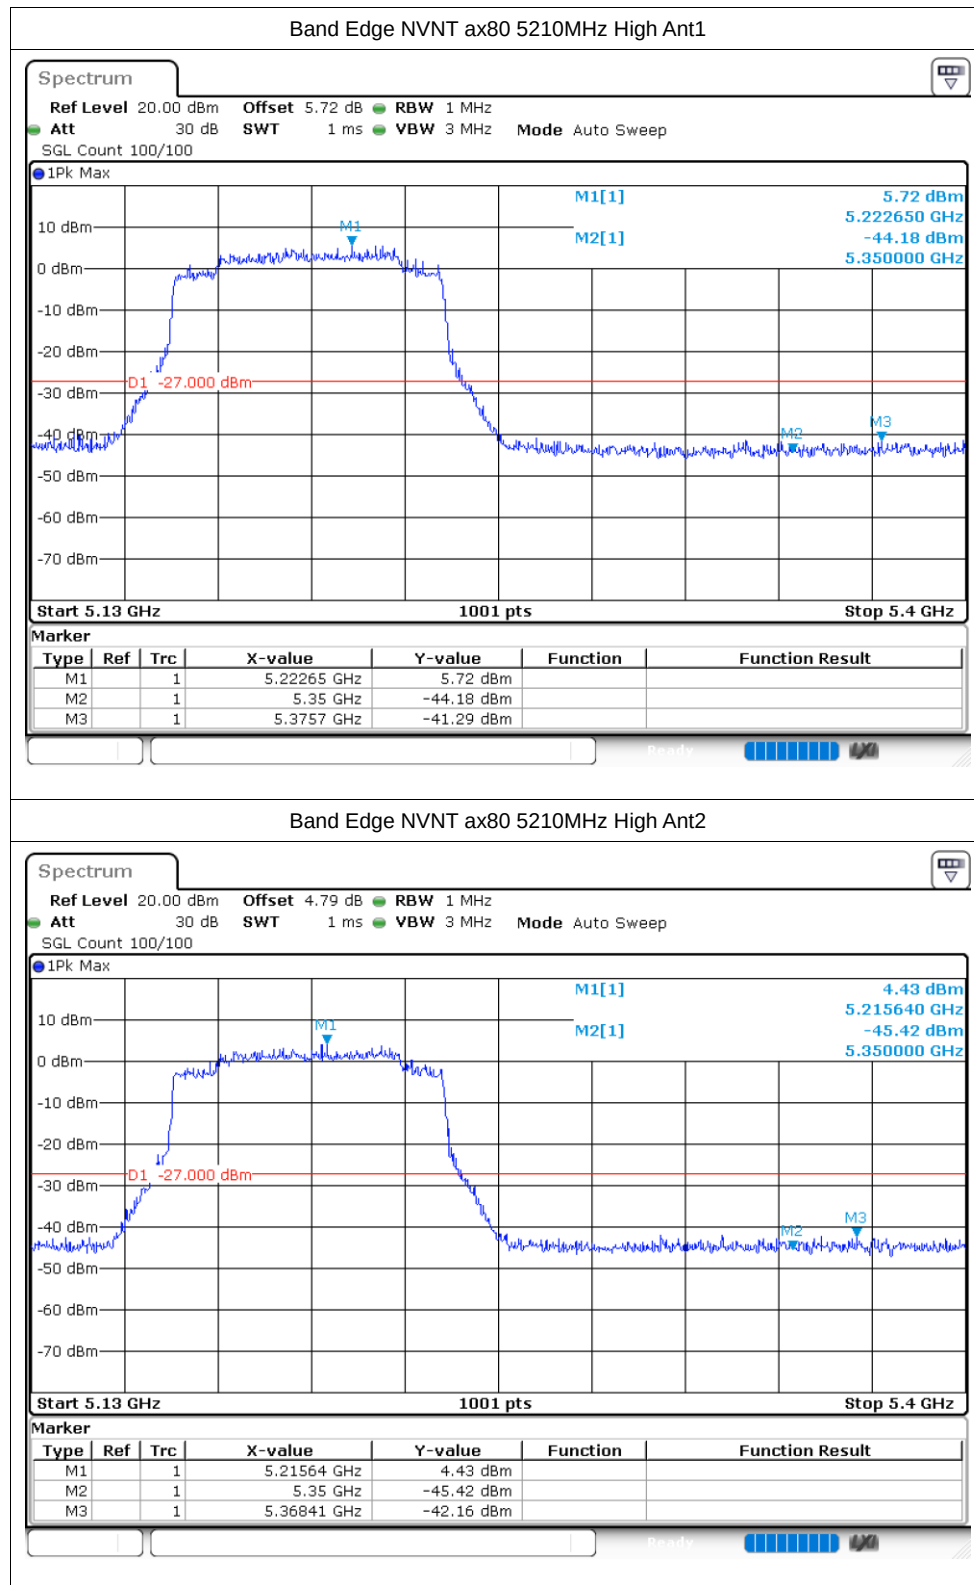

Conducted RF Spurious Emission

Condition	Mode	Frequency (MHz)	Antenna	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	a	5180	Ant1	-33.09	-27	Pass
NVNT	a	5200	Ant1	-32.81	-27	Pass
NVNT	a	5240	Ant1	-33.08	-27	Pass
NVNT	a	5180	Ant2	-33.24	-27	Pass
NVNT	a	5200	Ant2	-34.26	-27	Pass
NVNT	a	5240	Ant2	-34.25	-27	Pass
NVNT	n20	5180	Ant1	-41.38	-27	Pass
NVNT	n20	5200	Ant1	-40.15	-27	Pass
NVNT	n20	5240	Ant1	-41.14	-27	Pass
NVNT	n20	5180	Ant2	-34.11	-27	Pass
NVNT	n20	5200	Ant2	-33.85	-27	Pass
NVNT	n20	5240	Ant2	-33.75	-27	Pass
NVNT	n40	5190	Ant1	-40.5	-27	Pass
NVNT	n40	5230	Ant1	-41.12	-27	Pass
NVNT	n40	5190	Ant2	-34.21	-27	Pass
NVNT	n40	5230	Ant2	-34.12	-27	Pass
NVNT	ac20	5180	Ant1	-32.38	-27	Pass
NVNT	ac20	5200	Ant1	-33.37	-27	Pass
NVNT	ac20	5240	Ant1	-33.24	-27	Pass
NVNT	ac20	5180	Ant2	-33.91	-27	Pass
NVNT	ac20	5200	Ant2	-32.77	-27	Pass
NVNT	ac20	5240	Ant2	-33.81	-27	Pass
NVNT	ac40	5190	Ant1	-41.82	-27	Pass
NVNT	ac40	5230	Ant1	-41.71	-27	Pass
NVNT	ac40	5190	Ant2	-33.71	-27	Pass
NVNT	ac40	5230	Ant2	-33.37	-27	Pass
NVNT	ac80	5210	Ant1	-31.97	-27	Pass
NVNT	ac80	5210	Ant2	-33.6	-27	Pass
NVNT	ax20	5180	Ant1	-32.91	-27	Pass
NVNT	ax20	5200	Ant1	-33.55	-27	Pass
NVNT	ax20	5240	Ant1	-33.06	-27	Pass
NVNT	ax20	5180	Ant2	-34.66	-27	Pass
NVNT	ax20	5200	Ant2	-34.26	-27	Pass
NVNT	ax20	5240	Ant2	-32.44	-27	Pass
NVNT	ax40	5190	Ant1	-32.97	-27	Pass
NVNT	ax40	5230	Ant1	-32.21	-27	Pass
NVNT	ax40	5190	Ant2	-33.64	-27	Pass
NVNT	ax40	5230	Ant2	-34.04	-27	Pass
NVNT	ax80	5210	Ant1	-32.55	-27	Pass
NVNT	ax80	5210	Ant2	-34.46	-27	Pass

