



Appendix N: Test Data for E-UTRA Band 41

Product Name: Android 13 Tablet 10.1

Test Model: G11

Environmental Conditions

Temperature:	23.8° C
Relative Humidity:	52.2%
ATM Pressure:	100.0 kPa
Test Engineer:	Nick Peng
Supervised by:	Ling Zhu



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



N.1 Conducted power

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	22.12	PASS
Band41	5MHz	16QAM	39675	1RB#0	21.52	PASS
Band41	5MHz	QPSK	39675	1RB#12	22.29	PASS
Band41	5MHz	16QAM	39675	1RB#12	21.69	PASS
Band41	5MHz	QPSK	39675	1RB#24	22.18	PASS
Band41	5MHz	16QAM	39675	1RB#24	21.57	PASS
Band41	5MHz	QPSK	39675	12RB#0	21.22	PASS
Band41	5MHz	16QAM	39675	12RB#0	20.22	PASS
Band41	5MHz	QPSK	39675	12RB#6	21.21	PASS
Band41	5MHz	16QAM	39675	12RB#6	20.22	PASS
Band41	5MHz	QPSK	39675	12RB#13	21.23	PASS
Band41	5MHz	16QAM	39675	12RB#13	20.22	PASS
Band41	5MHz	QPSK	39675	25RB#0	21.31	PASS
Band41	5MHz	16QAM	39675	25RB#0	20.37	PASS
Band41	5MHz	QPSK	40620	1RB#0	22.47	PASS
Band41	5MHz	16QAM	40620	1RB#0	21.79	PASS
Band41	5MHz	QPSK	40620	1RB#12	22.55	PASS
Band41	5MHz	16QAM	40620	1RB#12	21.94	PASS
Band41	5MHz	QPSK	40620	1RB#24	22.42	PASS
Band41	5MHz	16QAM	40620	1RB#24	21.79	PASS
Band41	5MHz	QPSK	40620	12RB#0	21.55	PASS
Band41	5MHz	16QAM	40620	12RB#0	20.56	PASS
Band41	5MHz	QPSK	40620	12RB#6	21.55	PASS
Band41	5MHz	16QAM	40620	12RB#6	20.55	PASS
Band41	5MHz	QPSK	40620	12RB#13	21.48	PASS
Band41	5MHz	16QAM	40620	12RB#13	20.47	PASS
Band41	5MHz	QPSK	40620	25RB#0	21.53	PASS
Band41	5MHz	16QAM	40620	25RB#0	20.58	PASS
Band41	5MHz	QPSK	41565	1RB#0	22.58	PASS
Band41	5MHz	16QAM	41565	1RB#0	21.91	PASS
Band41	5MHz	QPSK	41565	1RB#12	22.66	PASS
Band41	5MHz	16QAM	41565	1RB#12	22.00	PASS
Band41	5MHz	QPSK	41565	1RB#24	22.51	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	5MHz	16QAM	41565	1RB#24	21.83	PASS
Band41	5MHz	QPSK	41565	12RB#0	21.61	PASS
Band41	5MHz	16QAM	41565	12RB#0	20.61	PASS
Band41	5MHz	QPSK	41565	12RB#6	21.61	PASS
Band41	5MHz	16QAM	41565	12RB#6	20.65	PASS
Band41	5MHz	QPSK	41565	12RB#13	21.58	PASS
Band41	5MHz	16QAM	41565	12RB#13	20.61	PASS
Band41	5MHz	QPSK	41565	25RB#0	21.65	PASS
Band41	5MHz	16QAM	41565	25RB#0	20.75	PASS
Band41	10MHz	QPSK	39700	1RB#0	22.25	PASS
Band41	10MHz	16QAM	39700	1RB#0	21.65	PASS
Band41	10MHz	QPSK	39700	1RB#24	22.49	PASS
Band41	10MHz	16QAM	39700	1RB#24	21.83	PASS
Band41	10MHz	QPSK	39700	1RB#49	22.27	PASS
Band41	10MHz	16QAM	39700	1RB#49	21.69	PASS
Band41	10MHz	QPSK	39700	25RB#0	21.41	PASS
Band41	15MHz	QPSK	39725	38RB#37	21.35	PASS
Band41	15MHz	16QAM	39725	38RB#37	21.36	PASS
Band41	15MHz	QPSK	39725	75RB#0	21.34	PASS
Band41	15MHz	16QAM	39725	75RB#0	20.40	PASS
Band41	15MHz	QPSK	40620	1RB#0	22.45	PASS
Band41	15MHz	16QAM	40620	1RB#0	21.82	PASS
Band41	15MHz	QPSK	40620	1RB#38	22.62	PASS
Band41	15MHz	16QAM	40620	1RB#38	21.95	PASS
Band41	15MHz	QPSK	40620	1RB#74	22.39	PASS
Band41	15MHz	16QAM	40620	1RB#74	21.76	PASS
Band41	15MHz	QPSK	40620	38RB#0	21.62	PASS
Band41	10MHz	16QAM	40620	1RB#49	21.88	PASS
Band41	10MHz	QPSK	40620	25RB#0	21.66	PASS
Band41	10MHz	16QAM	40620	25RB#0	20.78	PASS
Band41	10MHz	QPSK	40620	25RB#12	21.68	PASS
Band41	10MHz	16QAM	40620	25RB#12	20.78	PASS
Band41	10MHz	QPSK	40620	25RB#25	21.55	PASS
Band41	10MHz	16QAM	40620	25RB#25	20.67	PASS
Band41	10MHz	QPSK	40620	50RB#0	21.61	PASS
Band41	10MHz	16QAM	40620	50RB#0	20.65	PASS
Band41	10MHz	QPSK	41540	1RB#0	22.72	PASS
Band41	10MHz	QPSK	41540	1RB#24	22.88	PASS
Band41	10MHz	16QAM	41540	1RB#24	22.24	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	QPSK	41540	1RB#49	22.58	PASS
Band41	10MHz	16QAM	41540	1RB#49	21.95	PASS
Band41	10MHz	QPSK	41540	25RB#0	21.78	PASS
Band41	10MHz	16QAM	41540	25RB#0	20.91	PASS
Band41	10MHz	QPSK	41540	25RB#12	21.75	PASS
Band41	10MHz	16QAM	41540	25RB#12	20.91	PASS
Band41	10MHz	16QAM	41540	25RB#25	20.83	PASS
Band41	10MHz	QPSK	41540	50RB#0	21.76	PASS
Band41	10MHz	16QAM	41540	50RB#0	20.83	PASS
Band41	15MHz	QPSK	39725	1RB#0	22.18	PASS
Band41	15MHz	16QAM	39725	1RB#0	21.59	PASS
Band41	15MHz	QPSK	39725	1RB#38	22.29	PASS
Band41	15MHz	16QAM	39725	1RB#38	21.81	PASS
Band41	15MHz	16QAM	39725	1RB#74	21.55	PASS
Band41	15MHz	QPSK	39725	38RB#0	21.38	PASS
Band41	15MHz	16QAM	39725	38RB#0	21.36	PASS
Band41	15MHz	QPSK	39725	38RB#18	21.35	PASS
Band41	15MHz	16QAM	39725	38RB#18	21.37	PASS
Band41	15MHz	16QAM	40620	75RB#0	20.66	PASS
Band41	15MHz	QPSK	41515	1RB#0	22.68	PASS
Band41	15MHz	16QAM	41515	1RB#0	22.04	PASS
Band41	15MHz	QPSK	41515	1RB#38	22.77	PASS
Band41	15MHz	16QAM	41515	1RB#38	22.10	PASS
Band41	15MHz	QPSK	41515	1RB#74	22.50	PASS
Band41	15MHz	16QAM	41515	1RB#74	21.89	PASS
Band41	15MHz	QPSK	41515	38RB#0	21.74	PASS
Band41	15MHz	16QAM	41515	38RB#0	21.73	PASS
Band41	15MHz	QPSK	41515	38RB#18	21.74	PASS
Band41	15MHz	16QAM	41515	38RB#18	21.75	PASS
Band41	15MHz	QPSK	41515	38RB#37	21.74	PASS
Band41	15MHz	16QAM	41515	38RB#37	21.74	PASS
Band41	15MHz	QPSK	41515	75RB#0	21.74	PASS
Band41	15MHz	16QAM	41515	75RB#0	20.81	PASS
Band41	20MHz	QPSK	39750	1RB#0	22.13	PASS
Band41	20MHz	16QAM	39750	1RB#0	21.31	PASS
Band41	20MHz	QPSK	39750	1RB#49	22.52	PASS
Band41	20MHz	16QAM	39750	1RB#49	21.73	PASS
Band41	20MHz	QPSK	39750	1RB#99	21.99	PASS
Band41	20MHz	16QAM	39750	1RB#99	21.19	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	QPSK	39750	100RB#0	21.35	PASS
Band41	20MHz	16QAM	40620	50RB#25	20.77	PASS
Band41	20MHz	QPSK	40620	50RB#50	21.57	PASS
Band41	20MHz	16QAM	40620	50RB#50	20.61	PASS
Band41	20MHz	QPSK	40620	100RB#0	21.66	PASS
Band41	20MHz	16QAM	40620	100RB#0	20.67	PASS
Band41	20MHz	16QAM	41490	1RB#0	21.75	PASS
Band41	20MHz	QPSK	41490	1RB#49	22.95	PASS
Band41	20MHz	16QAM	41490	1RB#49	22.11	PASS
Band41	20MHz	QPSK	41490	1RB#99	22.38	PASS
Band41	20MHz	16QAM	41490	1RB#99	21.55	PASS
Band41	10MHz	16QAM	40620	1RB#24	22.14	PASS
Band41	10MHz	QPSK	40620	1RB#49	22.50	PASS
Band41	10MHz	16QAM	41540	1RB#0	22.06	PASS
Band41	20MHz	16QAM	41490	50RB#0	21.00	PASS
Band41	20MHz	QPSK	41490	50RB#25	21.90	PASS
Band41	20MHz	16QAM	41490	50RB#25	21.00	PASS
Band41	20MHz	QPSK	41490	50RB#50	21.64	PASS
Band41	20MHz	16QAM	41490	50RB#50	20.75	PASS
Band41	20MHz	QPSK	41490	100RB#0	21.79	PASS
Band41	20MHz	16QAM	41490	100RB#0	20.87	PASS
Band41	10MHz	QPSK	41540	25RB#25	21.69	PASS
Band41	15MHz	QPSK	39725	1RB#74	22.16	PASS
Band41	15MHz	16QAM	40620	38RB#0	21.63	PASS
Band41	15MHz	QPSK	40620	38RB#18	21.63	PASS
Band41	15MHz	16QAM	40620	38RB#18	21.61	PASS
Band41	15MHz	QPSK	40620	38RB#37	21.65	PASS
Band41	15MHz	16QAM	40620	38RB#37	21.63	PASS
Band41	15MHz	QPSK	40620	75RB#0	21.66	PASS
Band41	20MHz	QPSK	39750	50RB#0	21.40	PASS
Band41	20MHz	16QAM	39750	50RB#0	20.48	PASS
Band41	20MHz	QPSK	39750	50RB#25	21.41	PASS
Band41	20MHz	16QAM	39750	50RB#25	20.47	PASS
Band41	20MHz	QPSK	39750	50RB#50	21.31	PASS
Band41	20MHz	16QAM	39750	50RB#50	20.38	PASS
Band41	20MHz	16QAM	39750	100RB#0	20.41	PASS
Band41	20MHz	QPSK	40620	1RB#0	22.31	PASS
Band41	20MHz	16QAM	40620	1RB#0	21.54	PASS
Band41	20MHz	QPSK	40620	1RB#49	22.81	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	QPSK	41490	1RB#0	22.54	PASS
Band41	10MHz	16QAM	39700	25RB#0	20.48	PASS
Band41	10MHz	QPSK	39700	25RB#12	21.38	PASS
Band41	10MHz	16QAM	39700	25RB#12	20.50	PASS
Band41	10MHz	QPSK	39700	25RB#25	21.32	PASS
Band41	10MHz	16QAM	39700	25RB#25	20.48	PASS
Band41	10MHz	QPSK	39700	50RB#0	21.35	PASS
Band41	10MHz	16QAM	39700	50RB#0	20.43	PASS
Band41	10MHz	QPSK	40620	1RB#0	22.53	PASS
Band41	10MHz	16QAM	40620	1RB#0	21.89	PASS
Band41	10MHz	QPSK	40620	1RB#24	22.79	PASS
Band41	20MHz	QPSK	41490	50RB#0	21.93	PASS
Band41	20MHz	16QAM	40620	1RB#49	21.98	PASS
Band41	20MHz	QPSK	40620	1RB#99	22.27	PASS
Band41	20MHz	16QAM	40620	1RB#99	21.47	PASS
Band41	20MHz	QPSK	40620	50RB#0	21.74	PASS
Band41	20MHz	16QAM	40620	50RB#0	20.77	PASS
Band41	20MHz	QPSK	40620	50RB#25	21.72	PASS





N.2 Peak-to-Average Ratio (CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	5.85	13	PASS
Band41	5MHz	QPSK	40620	25RB#0	7.40	13	PASS
Band41	5MHz	16QAM	40620	25RB#0	9.92	13	PASS
Band41	5MHz	QPSK	41565	25RB#0	8.44	13	PASS
Band41	5MHz	16QAM	41565	25RB#0	8.79	13	PASS
Band41	10MHz	QPSK	39700	50RB#0	8.86	13	PASS
Band41	5MHz	16QAM	39675	25RB#0	7.67	13	PASS
Band41	10MHz	QPSK	40620	50RB#0	12.35	13	PASS
Band41	10MHz	16QAM	40620	50RB#0	10.00	13	PASS
Band41	10MHz	QPSK	41540	50RB#0	8.70	13	PASS
Band41	10MHz	16QAM	41540	50RB#0	10.27	13	PASS
Band41	15MHz	QPSK	39725	75RB#0	8.20	13	PASS
Band41	15MHz	16QAM	39725	75RB#0	10.10	13	PASS
Band41	15MHz	QPSK	40620	75RB#0	8.90	13	PASS
Band41	10MHz	16QAM	39700	50RB#0	8.82	13	PASS
Band41	15MHz	16QAM	41515	75RB#0	10.34	13	PASS
Band41	15MHz	16QAM	40620	75RB#0	9.66	13	PASS
Band41	15MHz	QPSK	41515	75RB#0	9.11	13	PASS
Band41	20MHz	QPSK	39750	100RB#0	7.19	13	PASS
Band41	20MHz	16QAM	39750	100RB#0	8.09	13	PASS
Band41	20MHz	QPSK	40620	100RB#0	6.32	13	PASS
Band41	20MHz	16QAM	40620	100RB#0	10.46	13	PASS
Band41	20MHz	QPSK	41490	100RB#0	8.58	13	PASS
Band41	20MHz	16QAM	41490	100RB#0	10.25	13	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Test Graphs

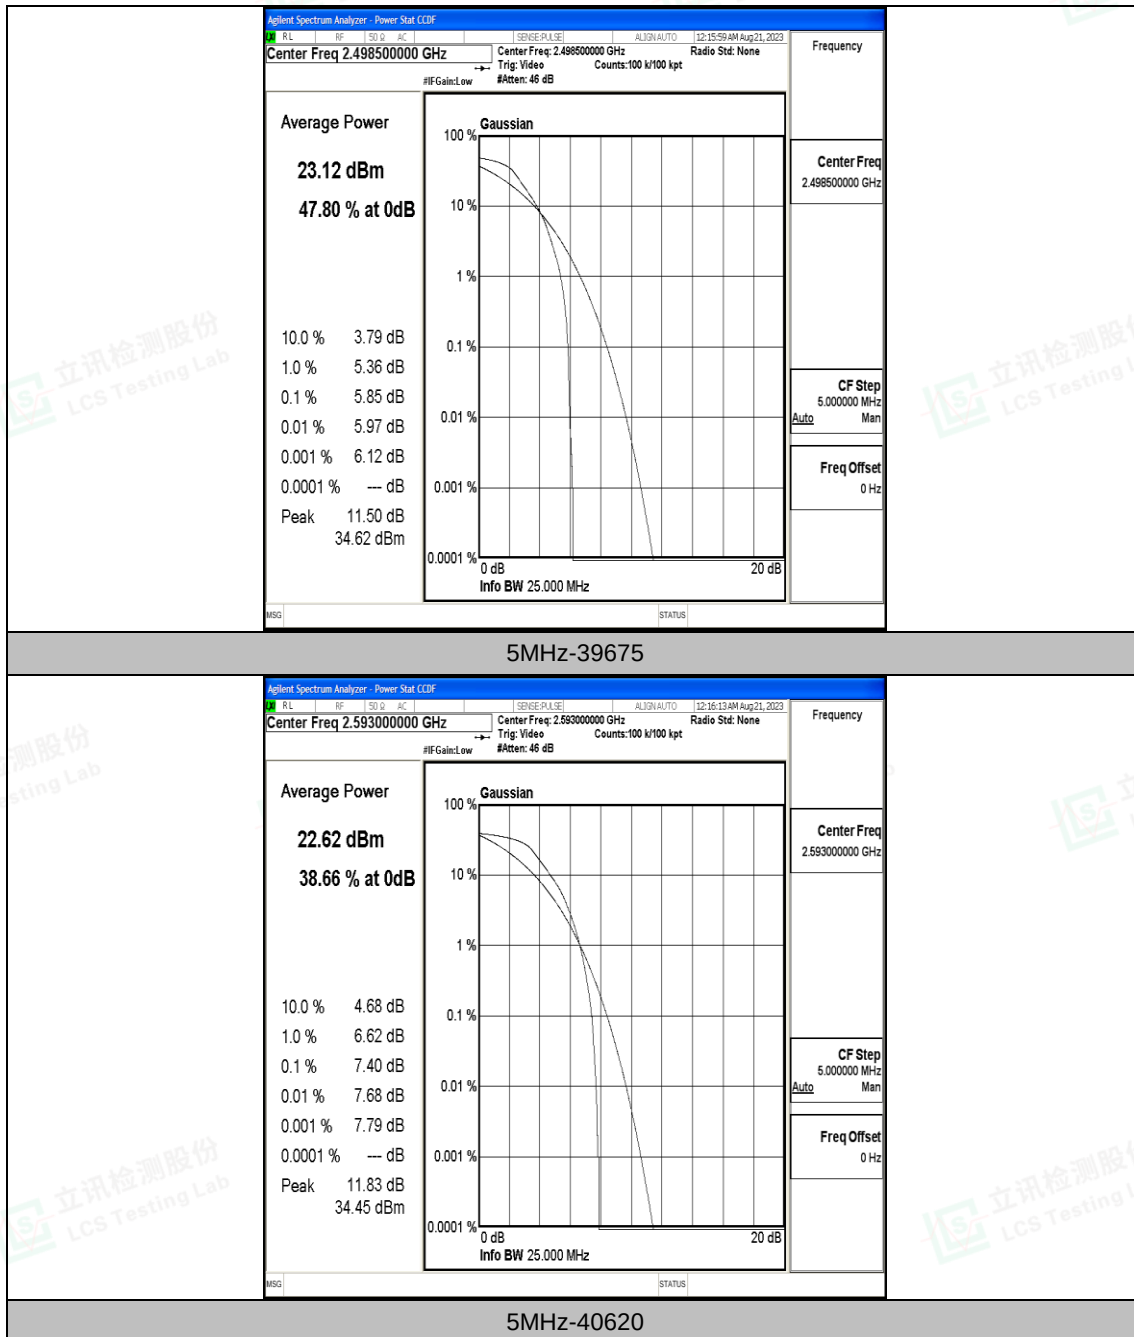


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

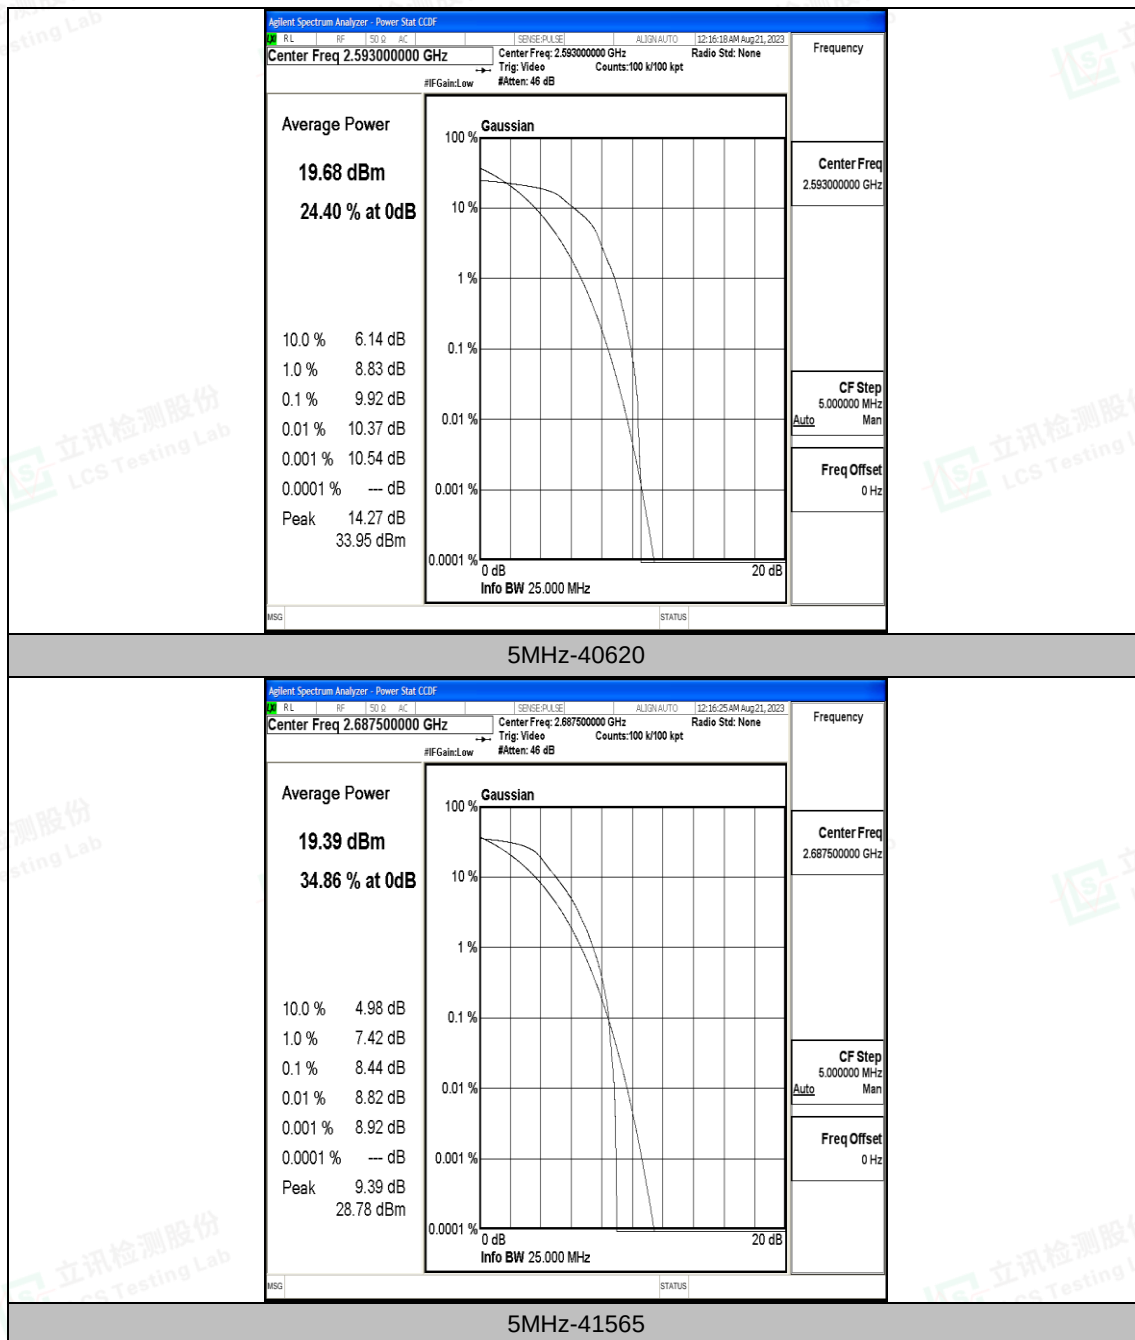


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

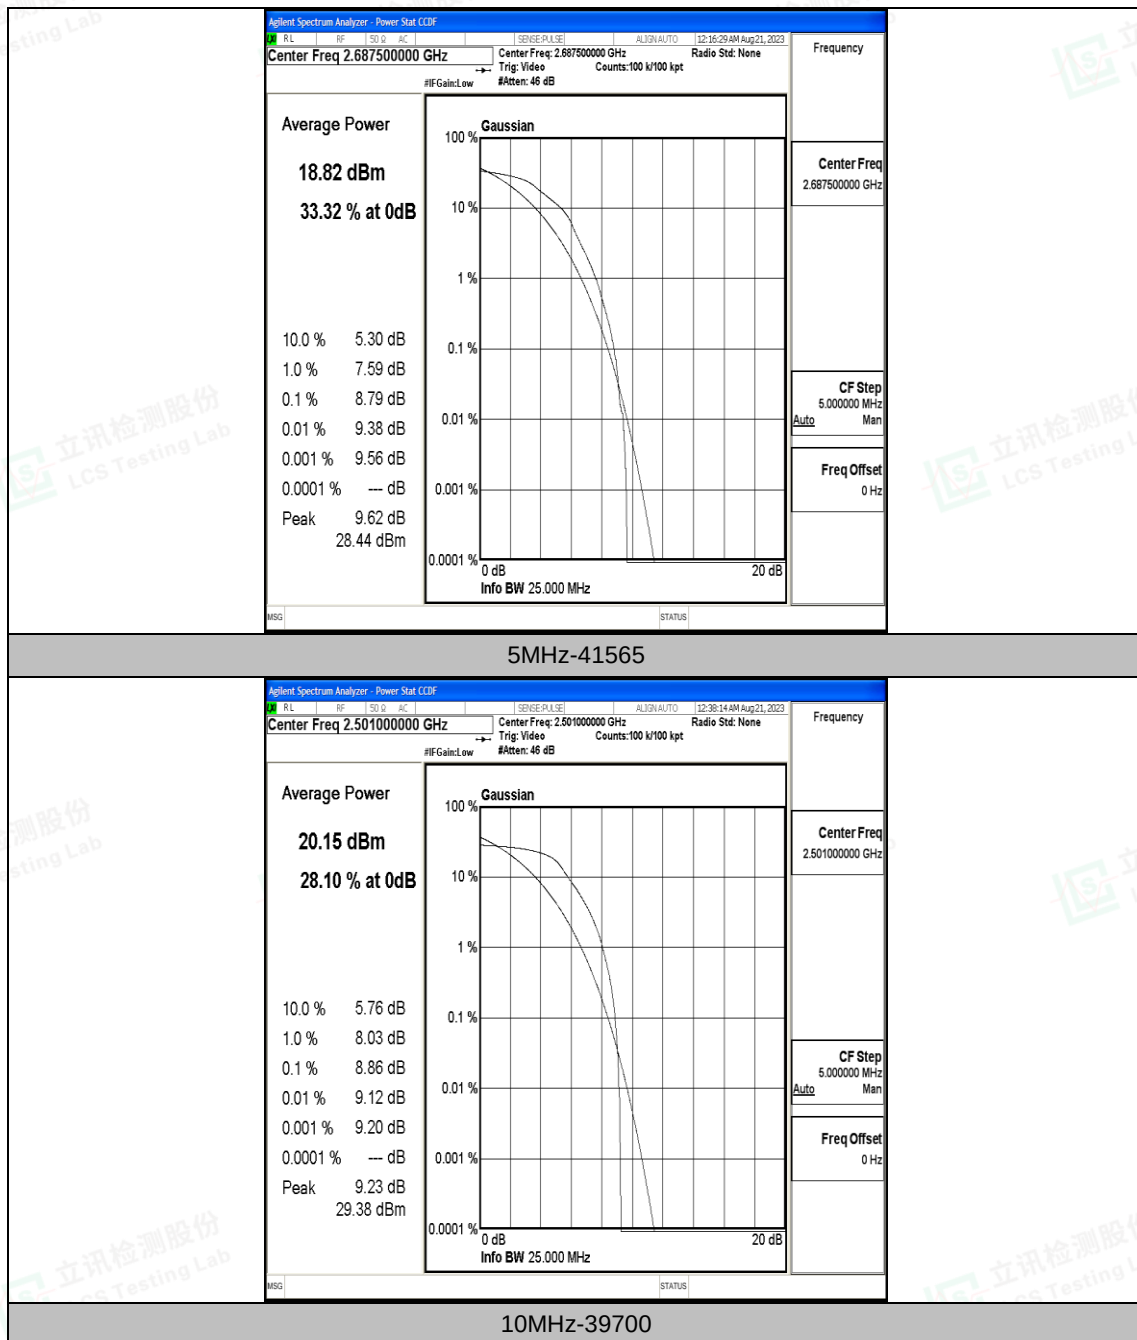


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

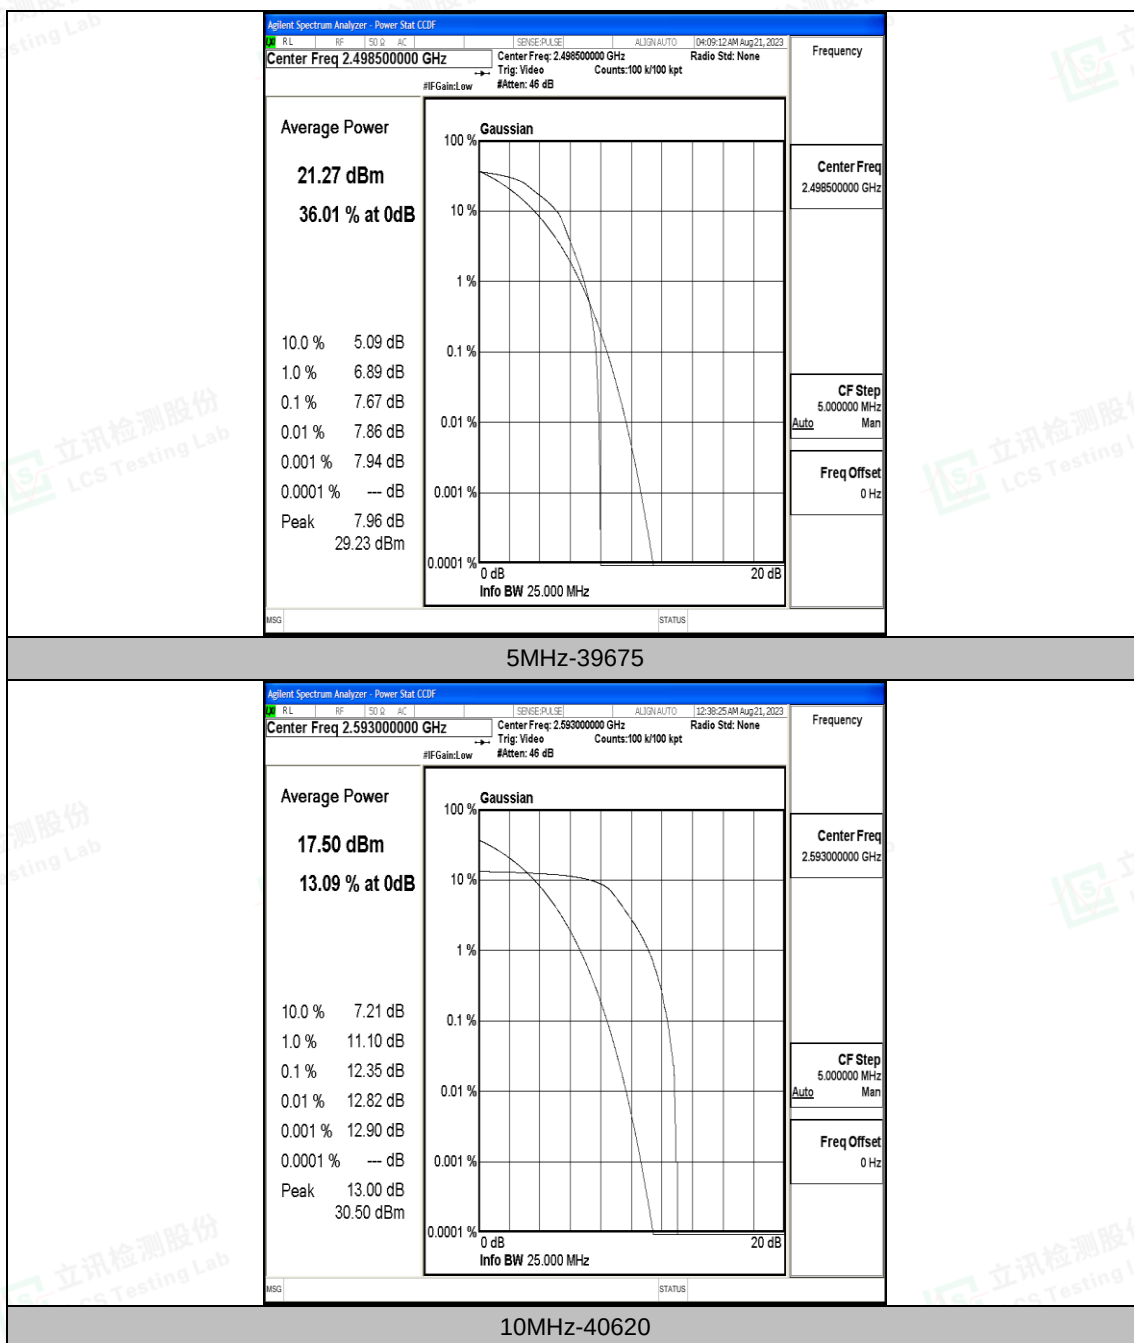


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

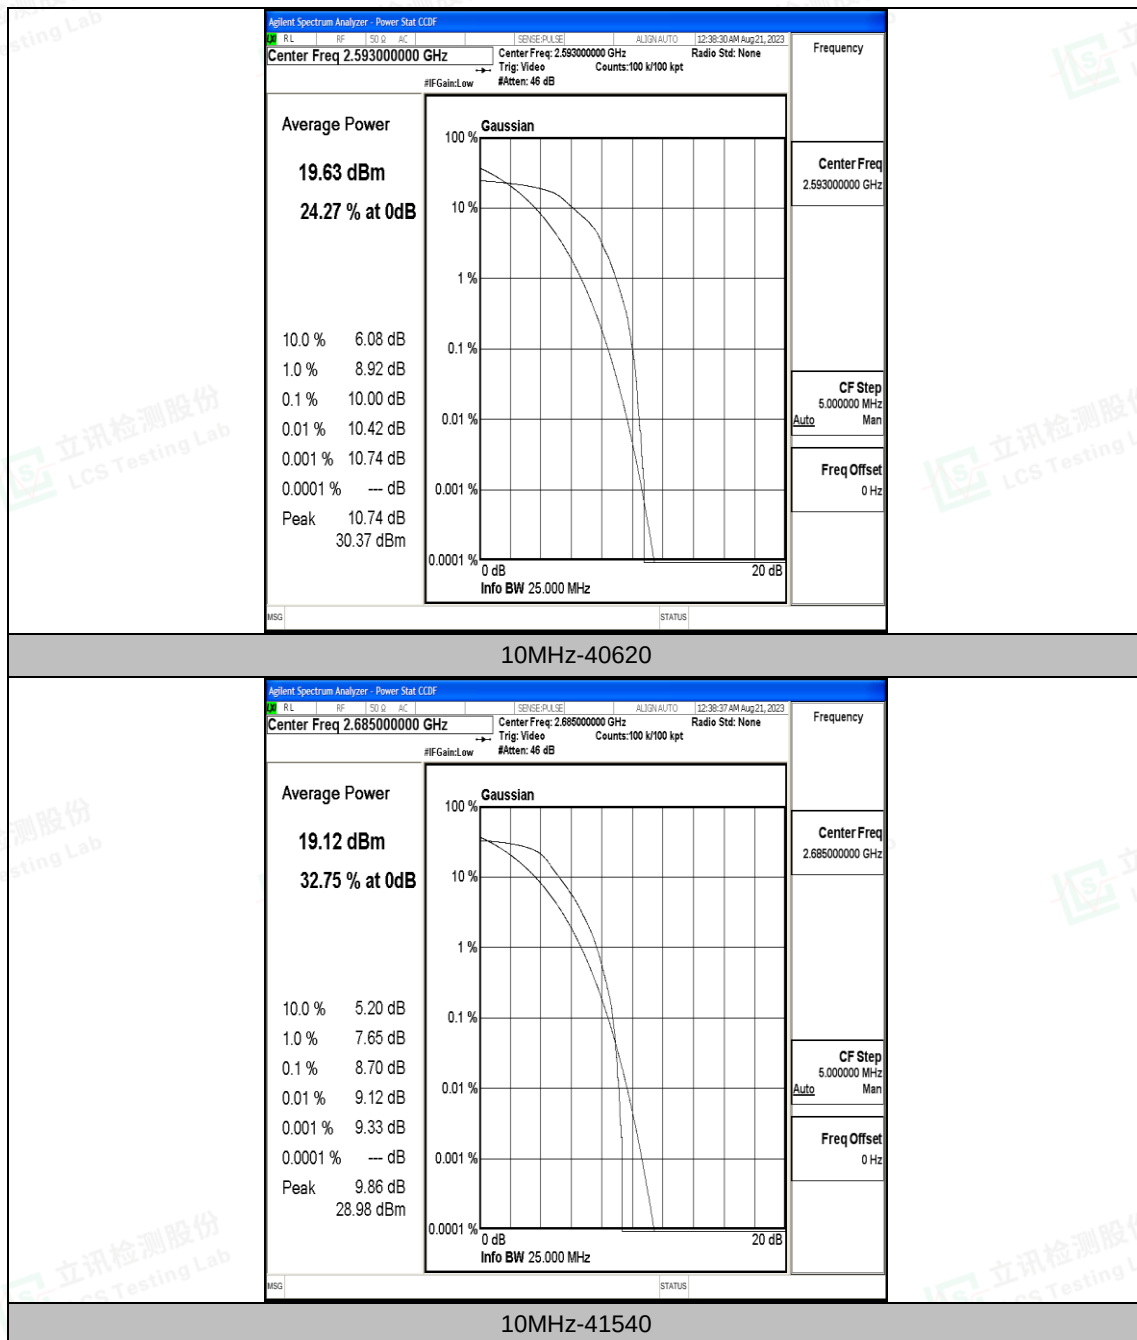


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

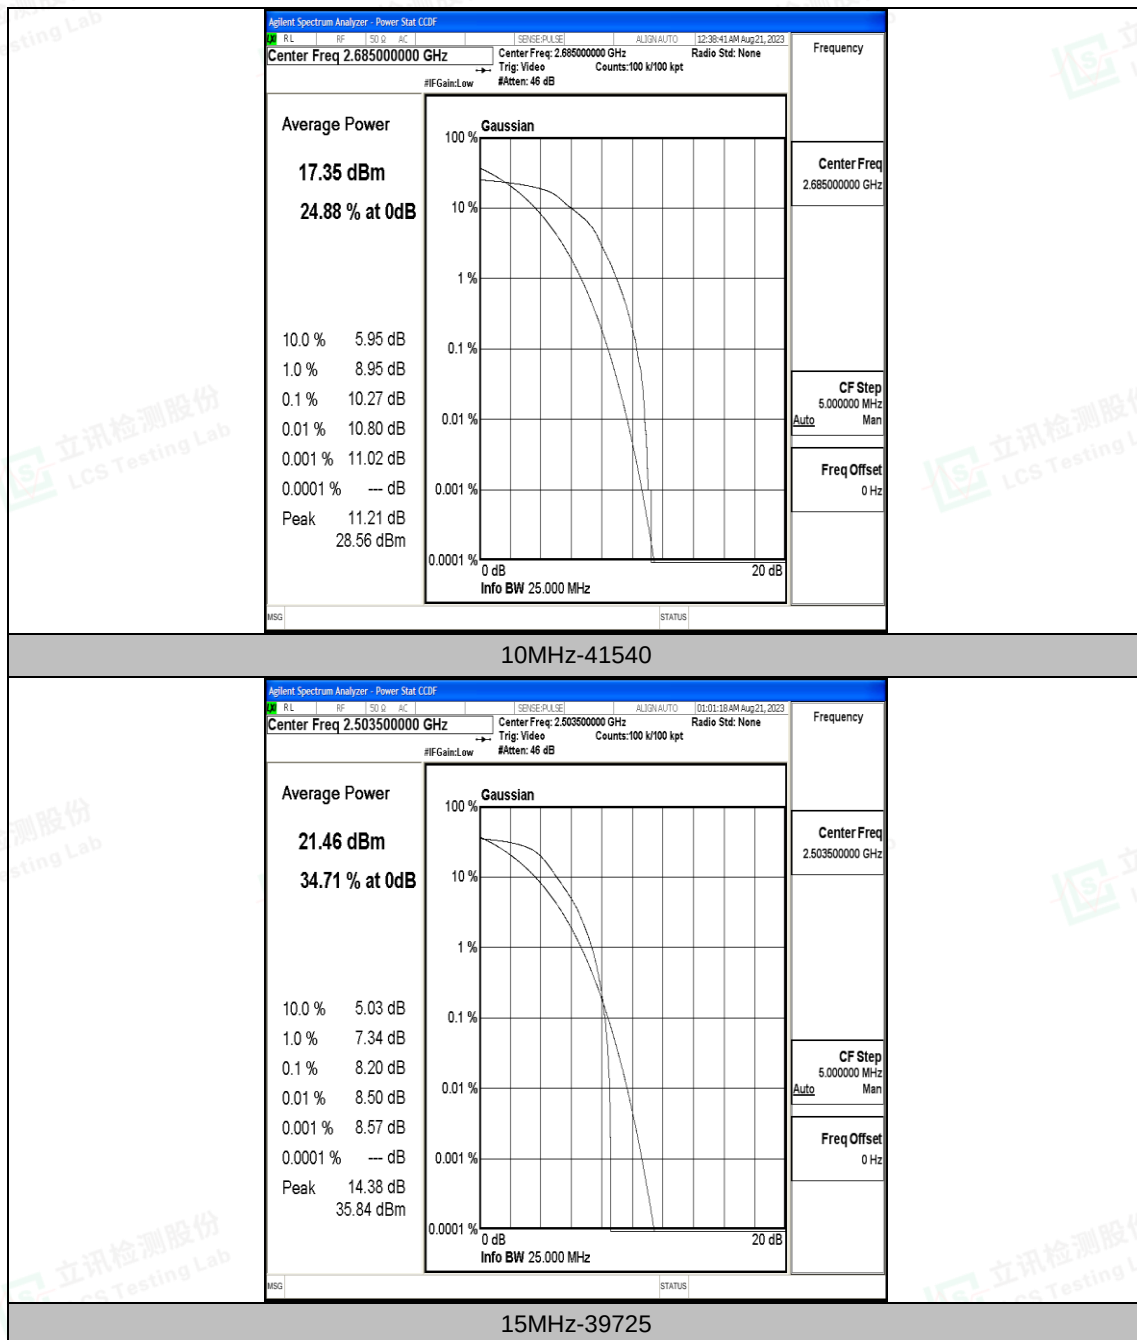



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

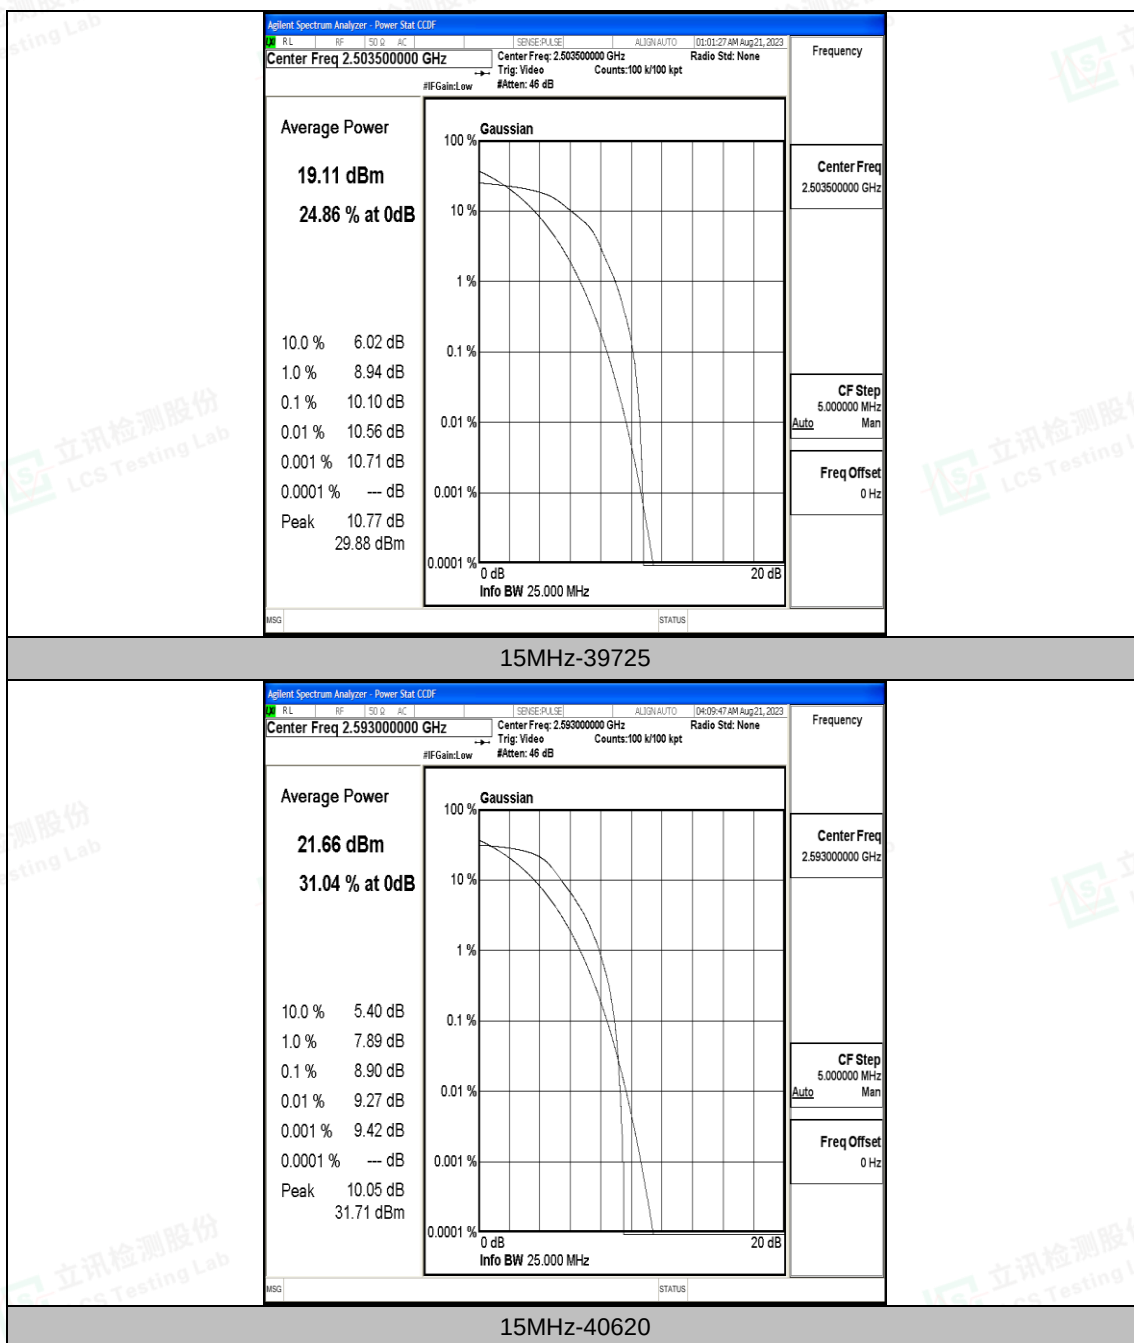

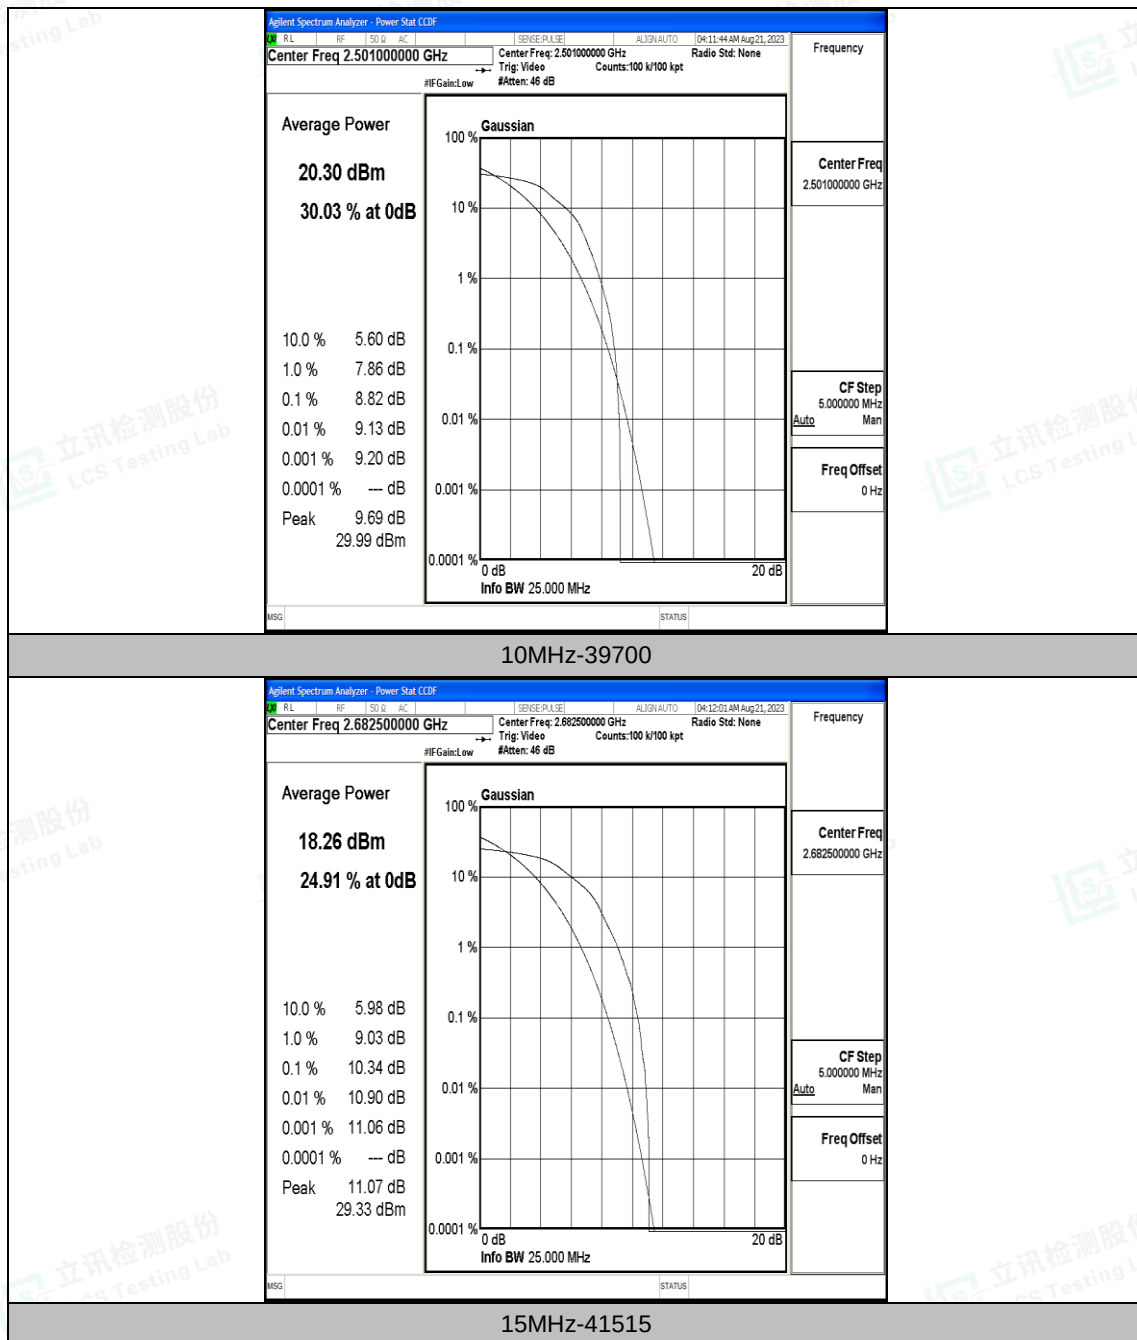


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

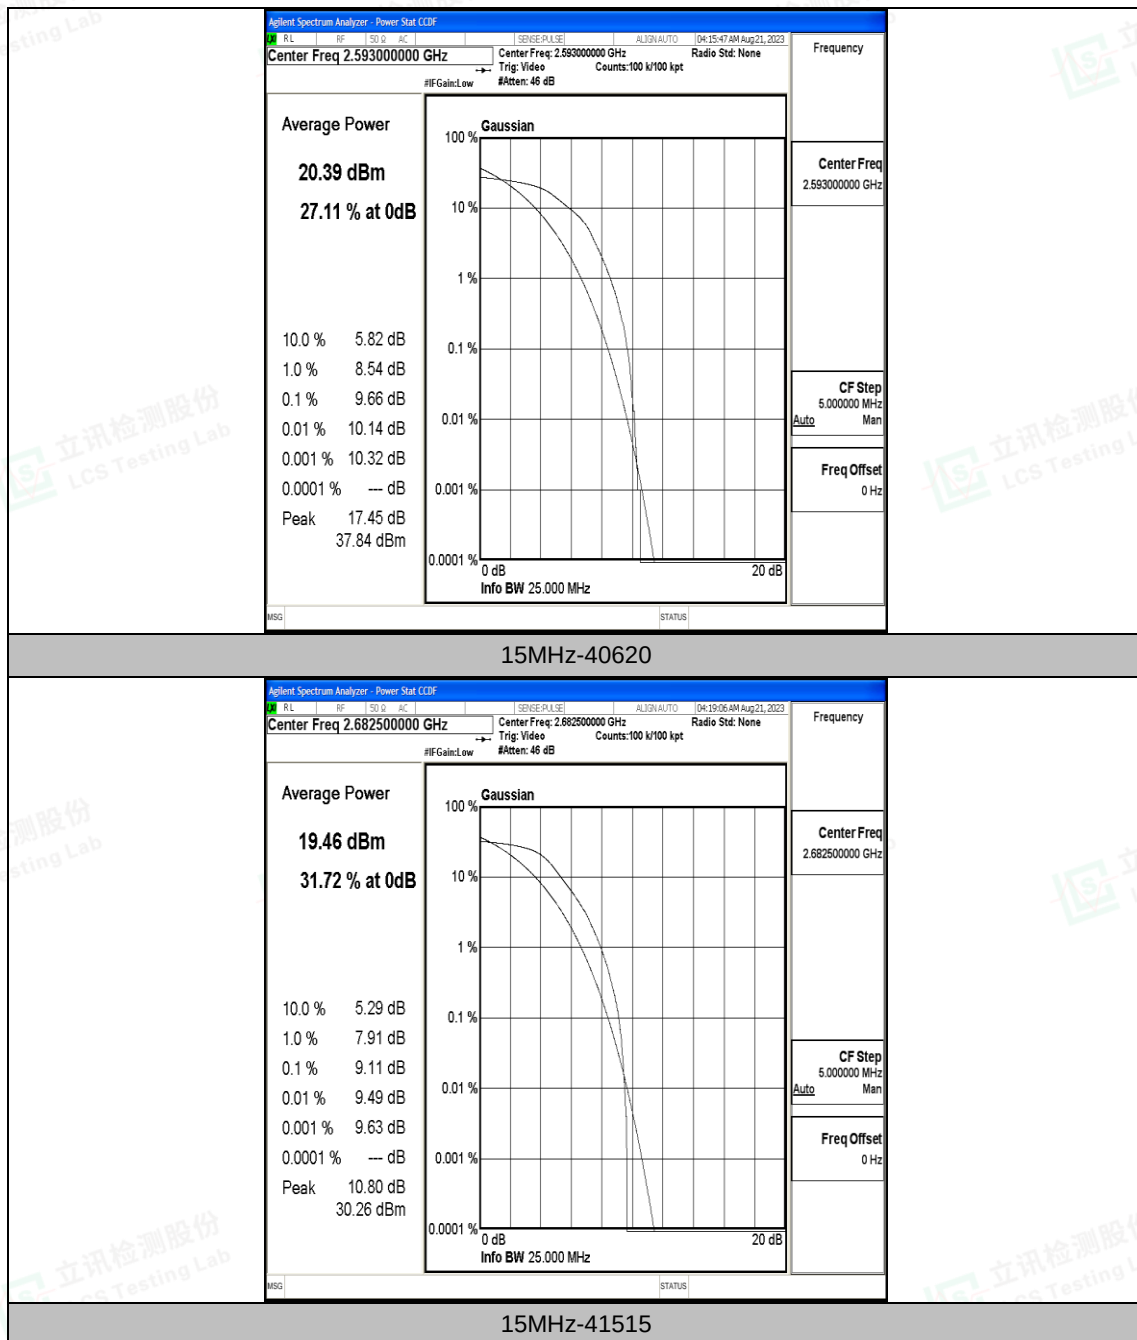


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

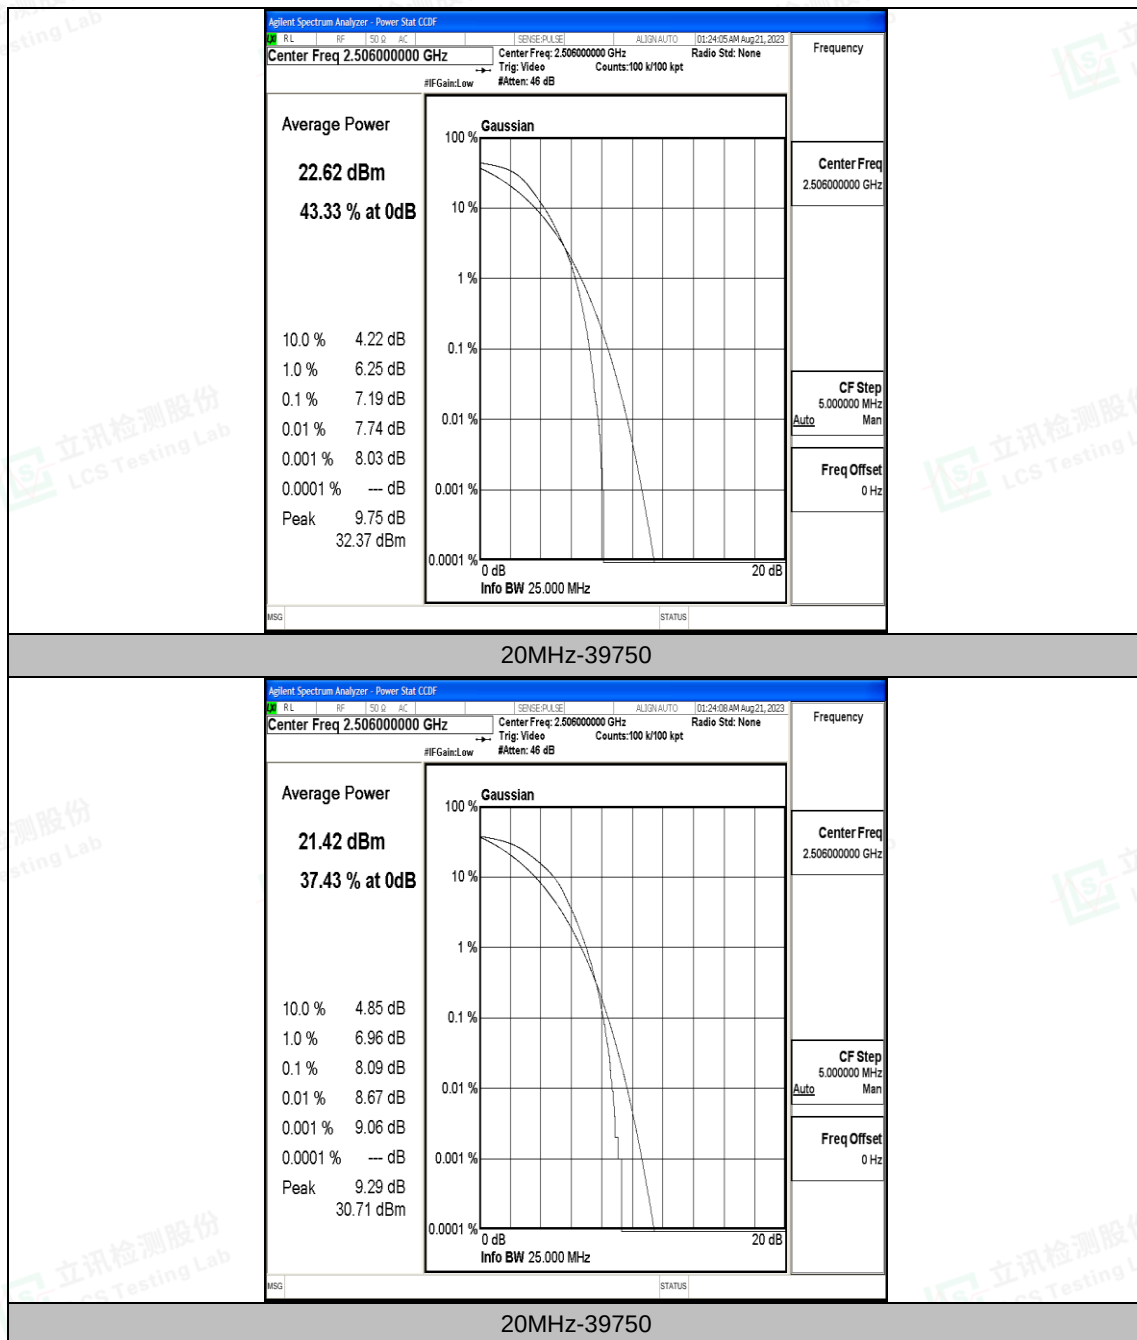


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

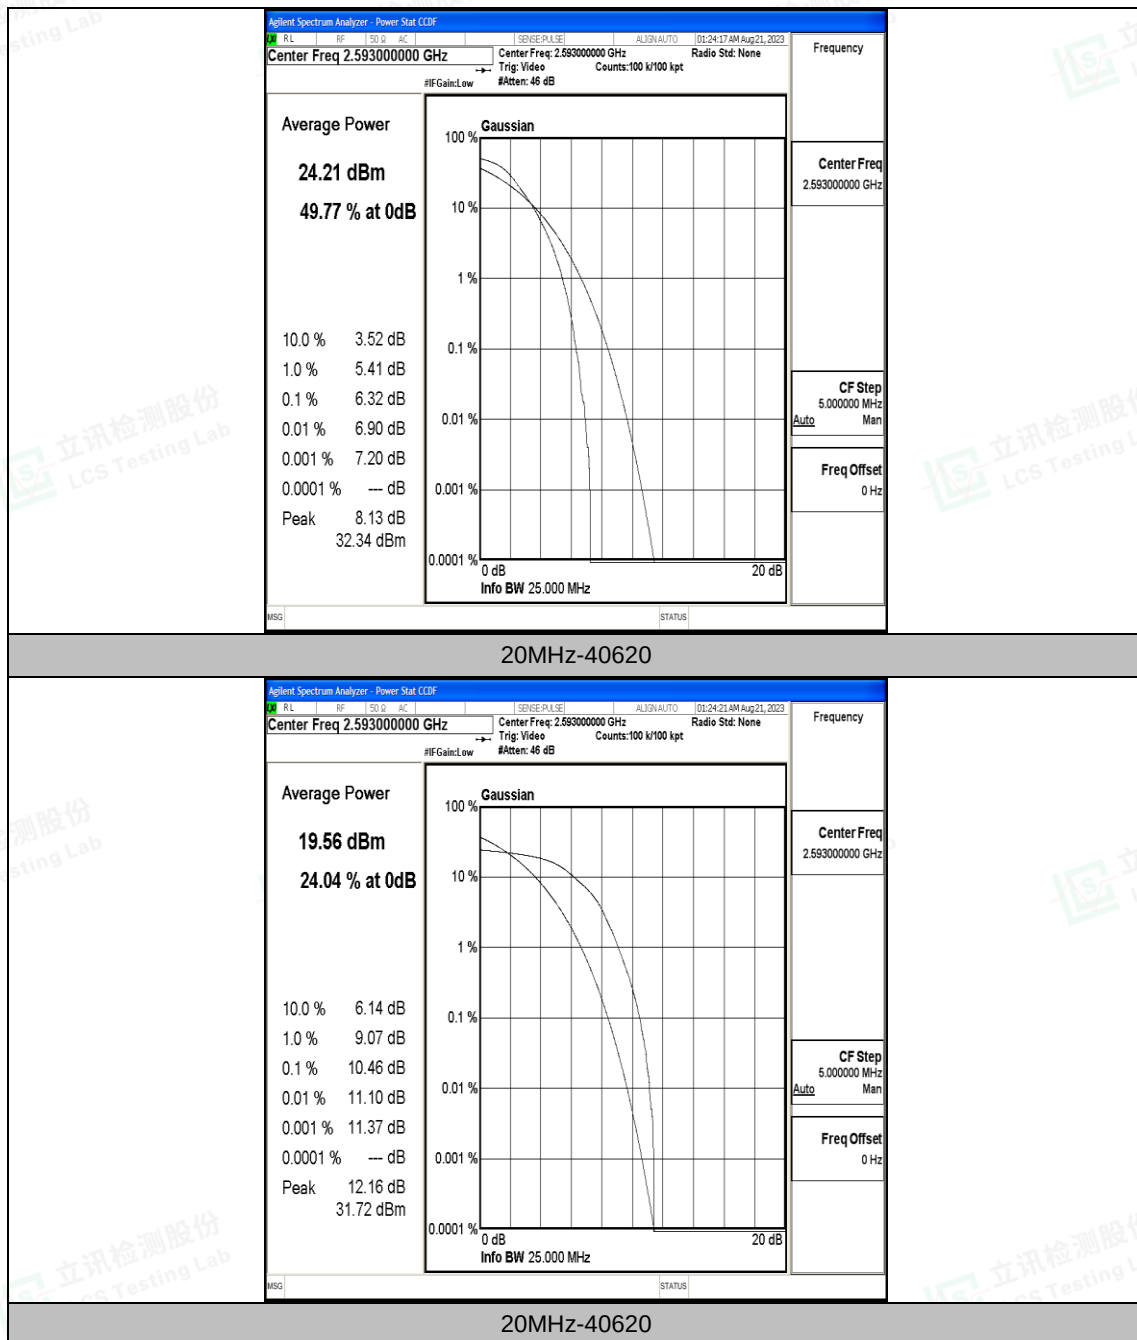


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

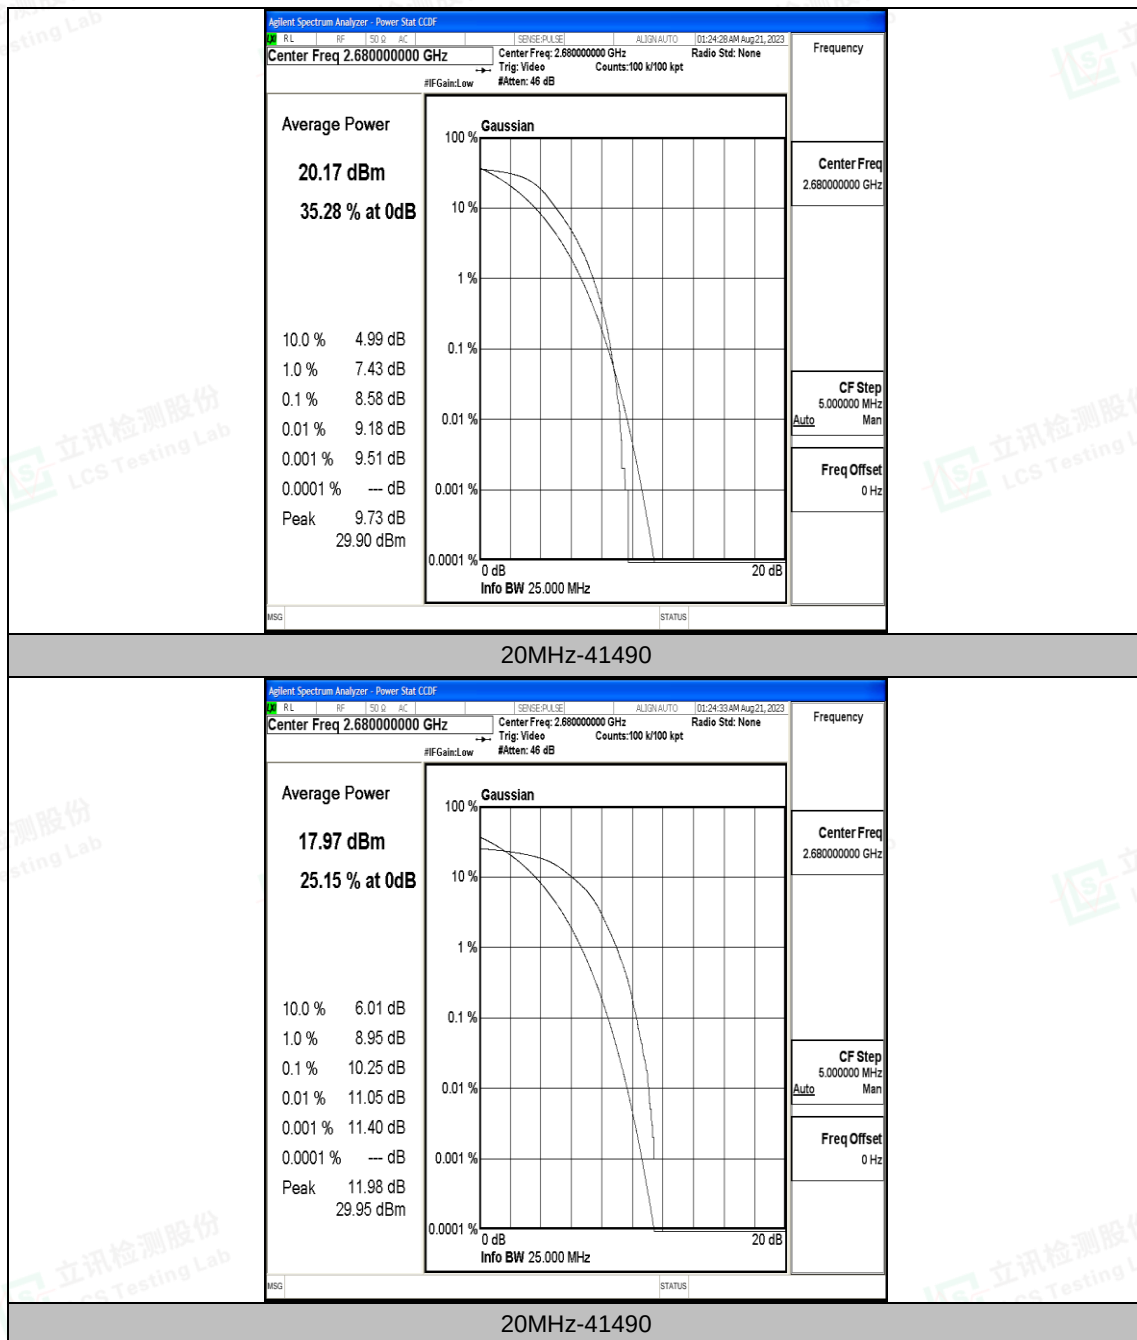

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



N.3 26dB Bandwidth and Occupied Bandwidth


Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	4.4995	5.132	PASS
Band41	5MHz	16QAM	39675	25RB#0	4.5018	5.526	PASS
Band41	5MHz	QPSK	40620	25RB#0	4.4939	4.924	PASS
Band41	5MHz	16QAM	40620	25RB#0	4.5025	5.349	PASS
Band41	5MHz	QPSK	41565	25RB#0	4.4996	5.293	PASS
Band41	5MHz	16QAM	41565	25RB#0	4.4927	4.981	PASS
Band41	10MHz	QPSK	39700	50RB#0	8.9642	9.802	PASS
Band41	10MHz	16QAM	39700	50RB#0	9.0000	9.777	PASS
Band41	10MHz	QPSK	40620	50RB#0	8.9950	9.917	PASS
Band41	10MHz	16QAM	40620	50RB#0	8.9702	10.12	PASS
Band41	10MHz	QPSK	41540	50RB#0	9.0083	10.47	PASS
Band41	15MHz	QPSK	39725	75RB#0	13.489	14.57	PASS
Band41	15MHz	QPSK	40620	75RB#0	13.525	15.79	PASS
Band41	15MHz	16QAM	40620	75RB#0	13.462	17.78	PASS
Band41	15MHz	QPSK	41515	75RB#0	13.495	16.06	PASS
Band41	15MHz	16QAM	41515	75RB#0	13.524	15.55	PASS
Band41	10MHz	16QAM	41540	50RB#0	8.9965	10.42	PASS
Band41	15MHz	16QAM	39725	75RB#0	13.497	15.95	PASS
Band41	20MHz	QPSK	39750	100RB#0	17.855	19.96	PASS
Band41	20MHz	16QAM	39750	100RB#0	17.955	19.47	PASS
Band41	20MHz	QPSK	40620	100RB#0	18.010	20.04	PASS
Band41	20MHz	QPSK	41490	100RB#0	18.018	19.73	PASS
Band41	20MHz	16QAM	41490	100RB#0	17.882	19.63	PASS
Band41	20MHz	16QAM	40620	100RB#0	17.907	20.12	PASS





Test Graphs

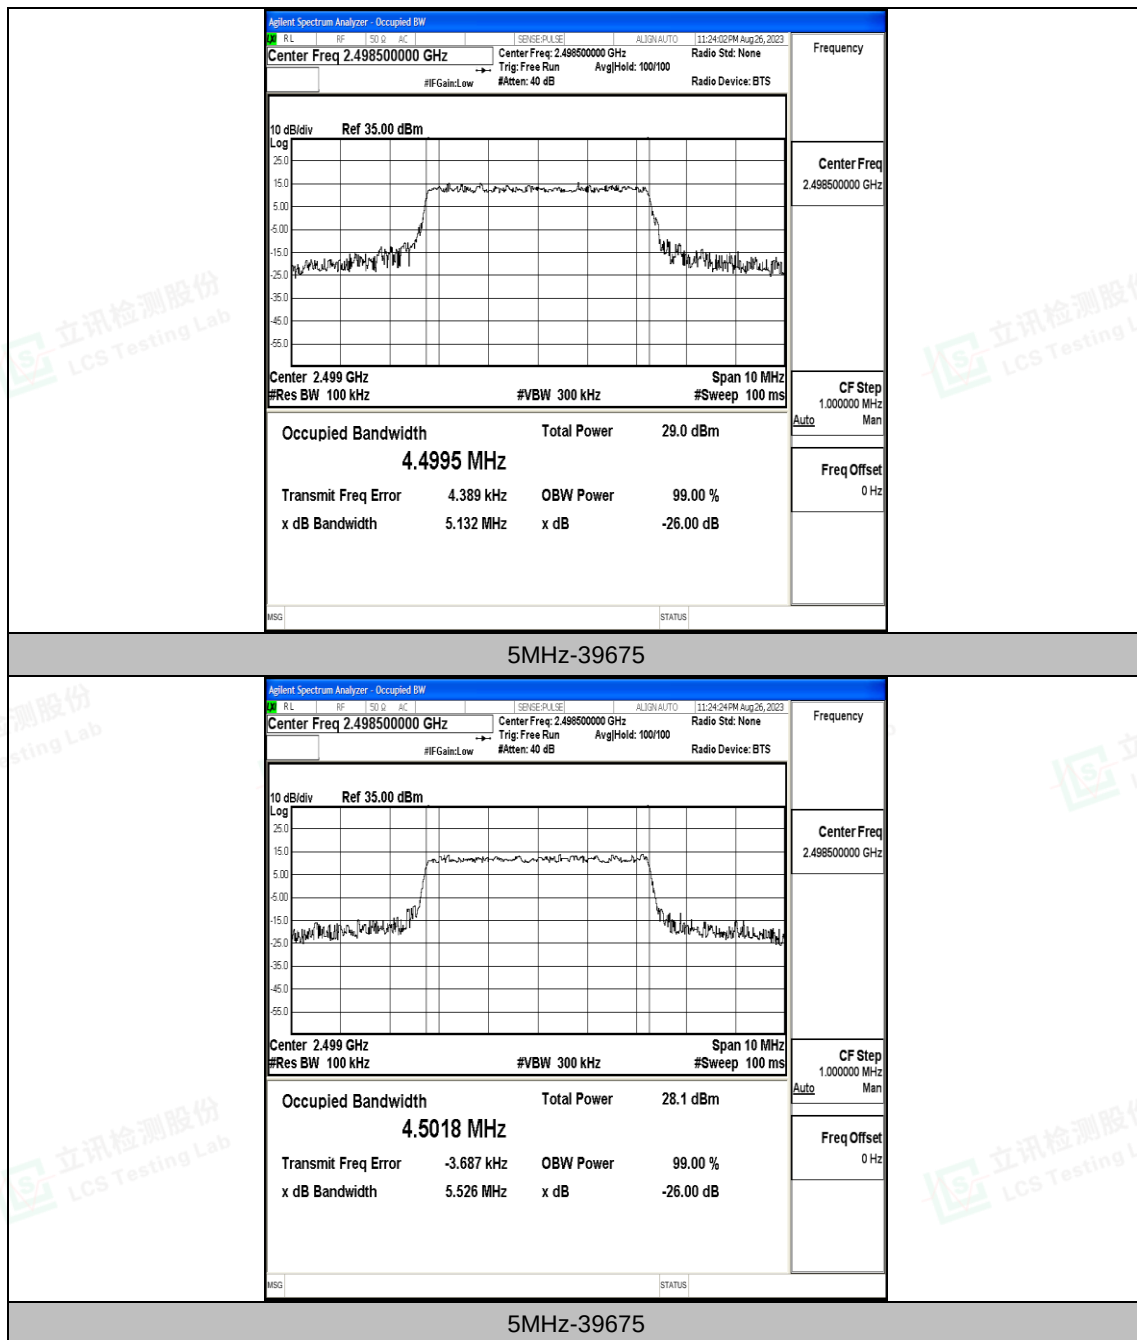

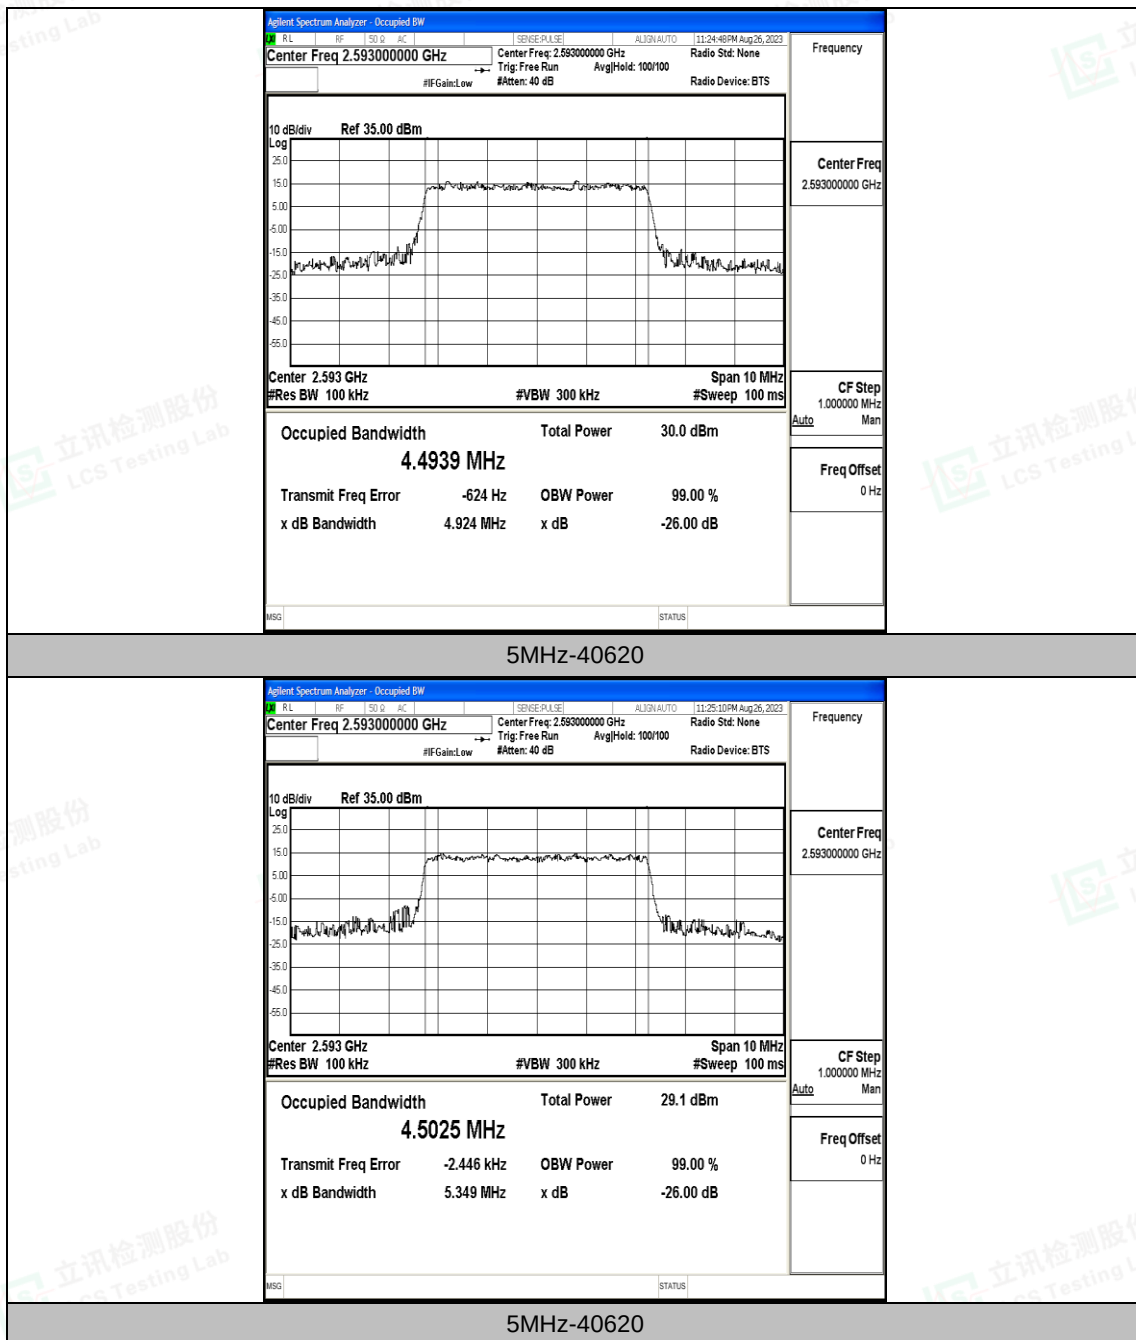


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

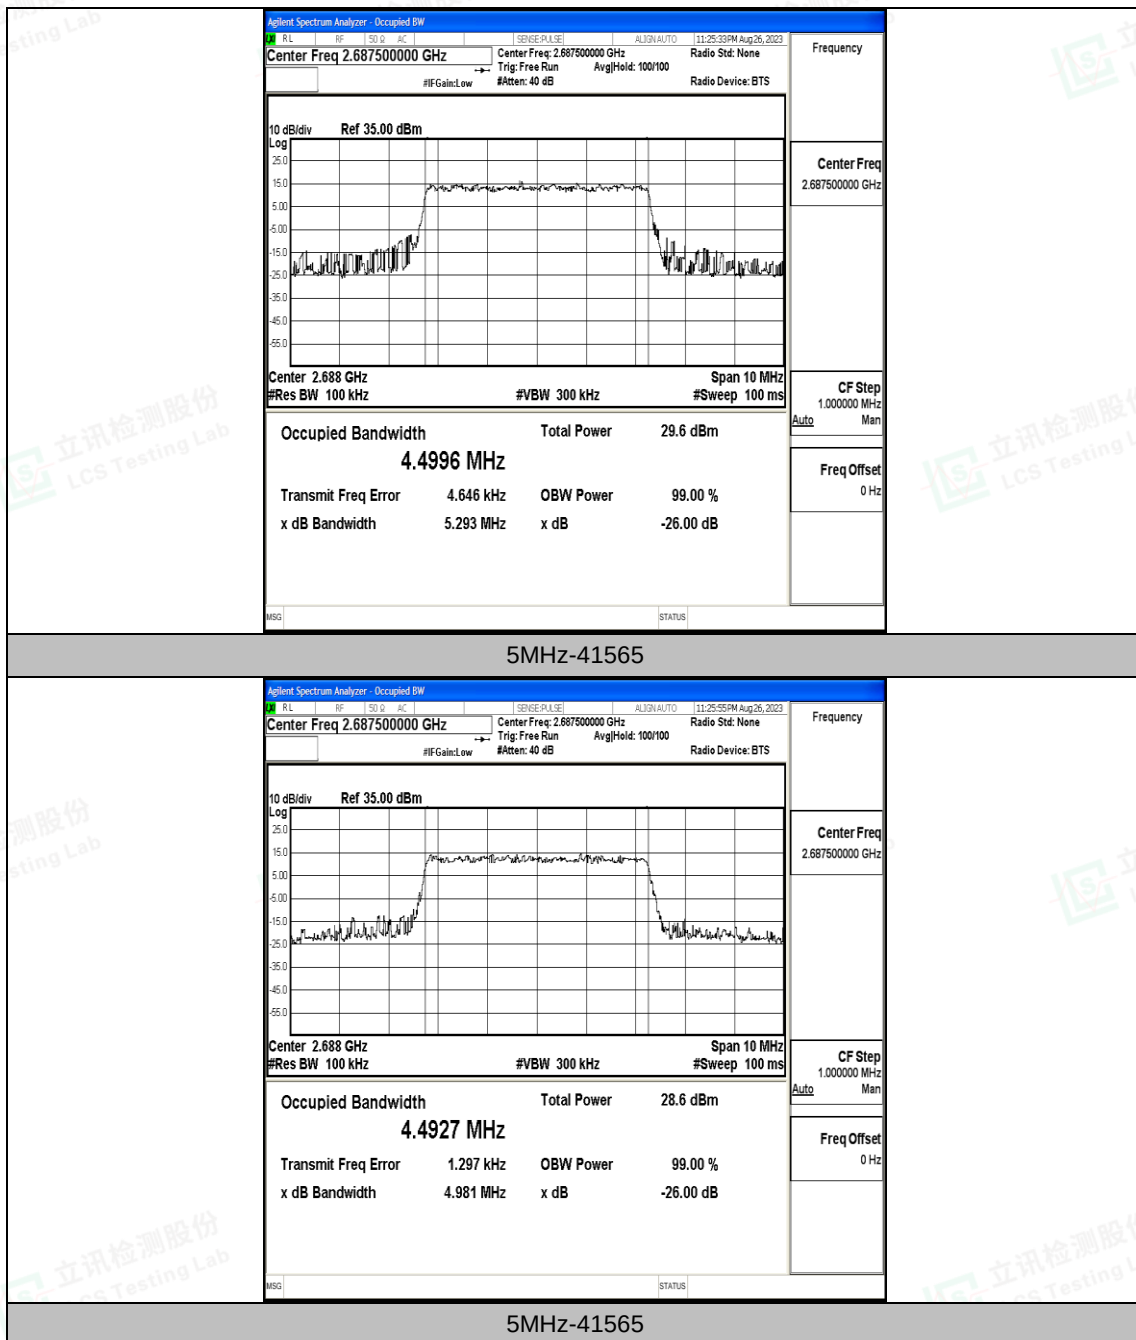



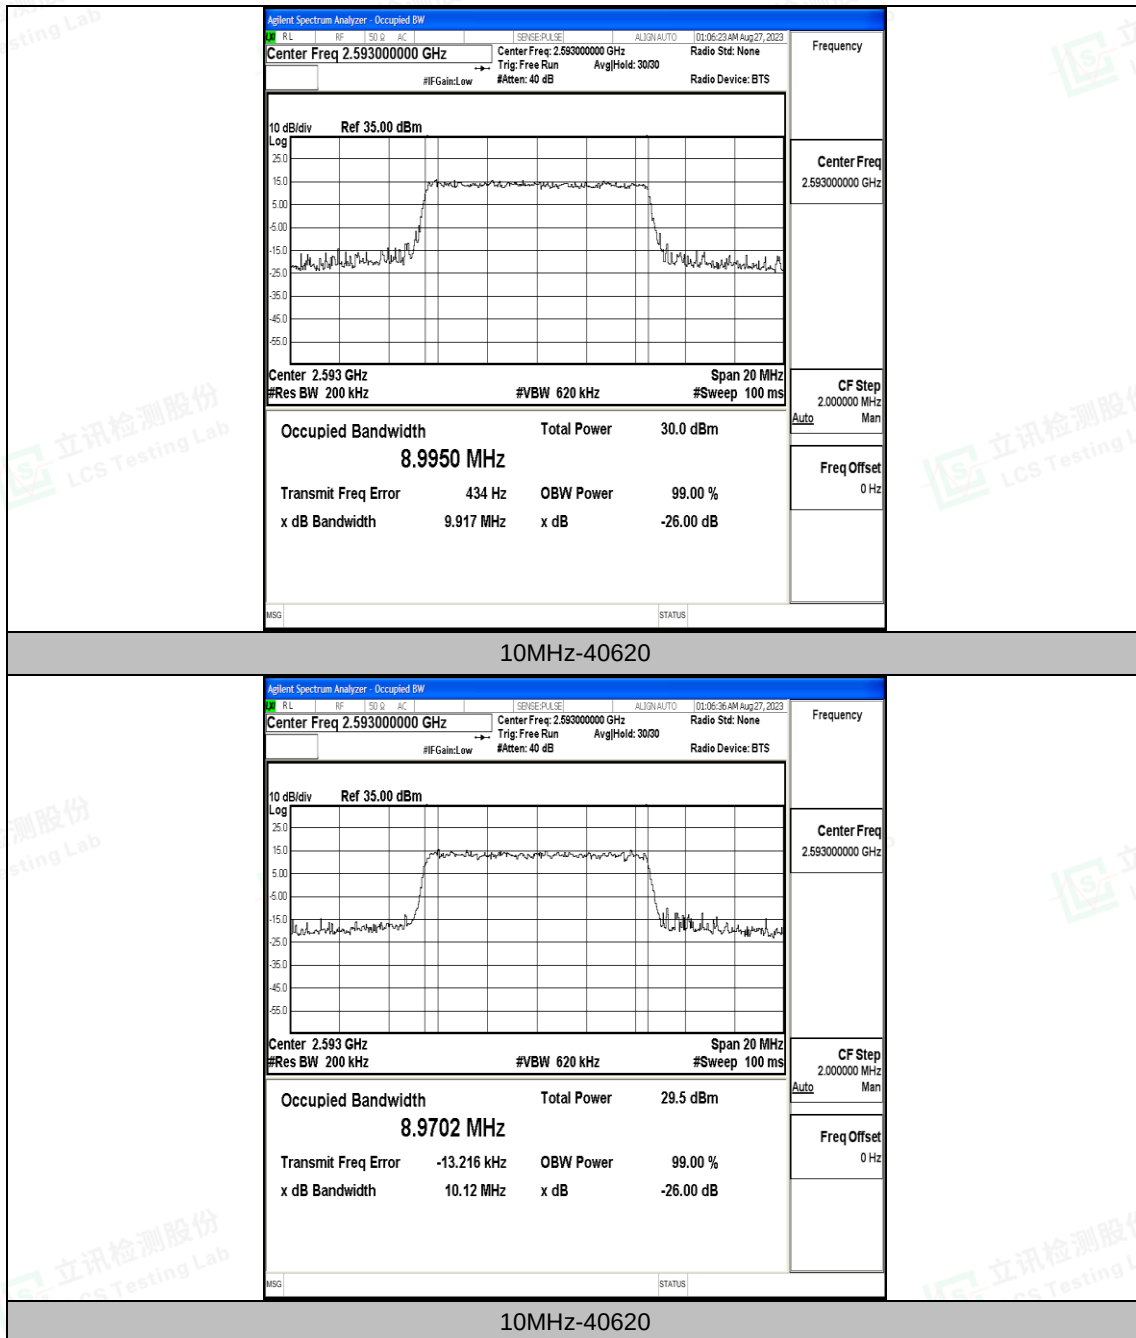

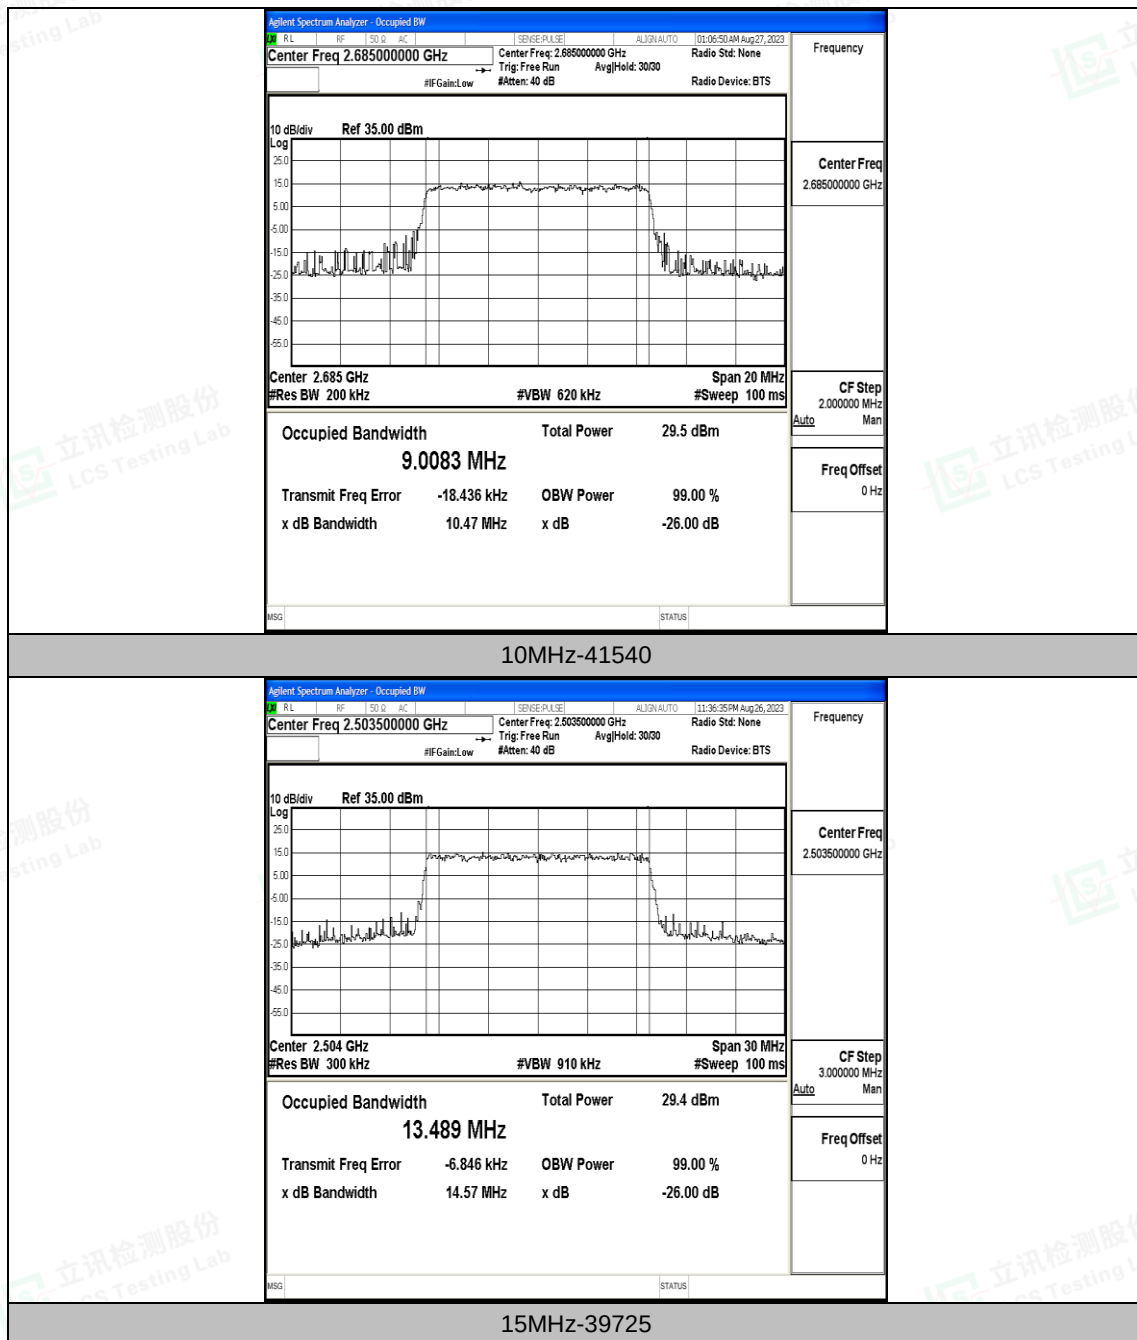


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

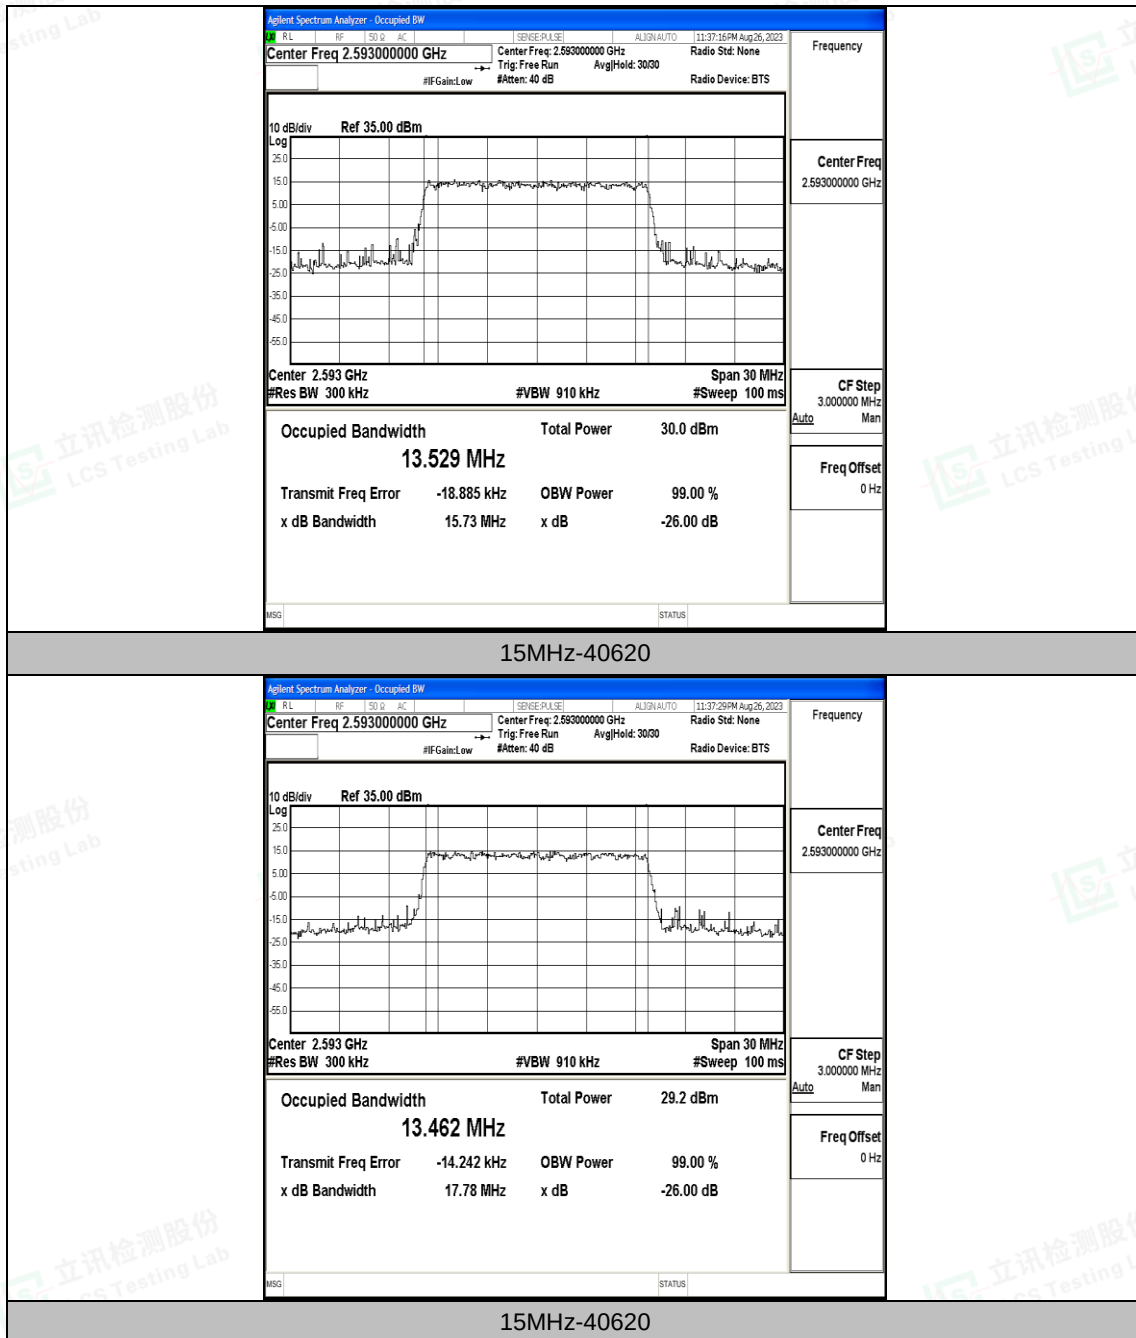



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

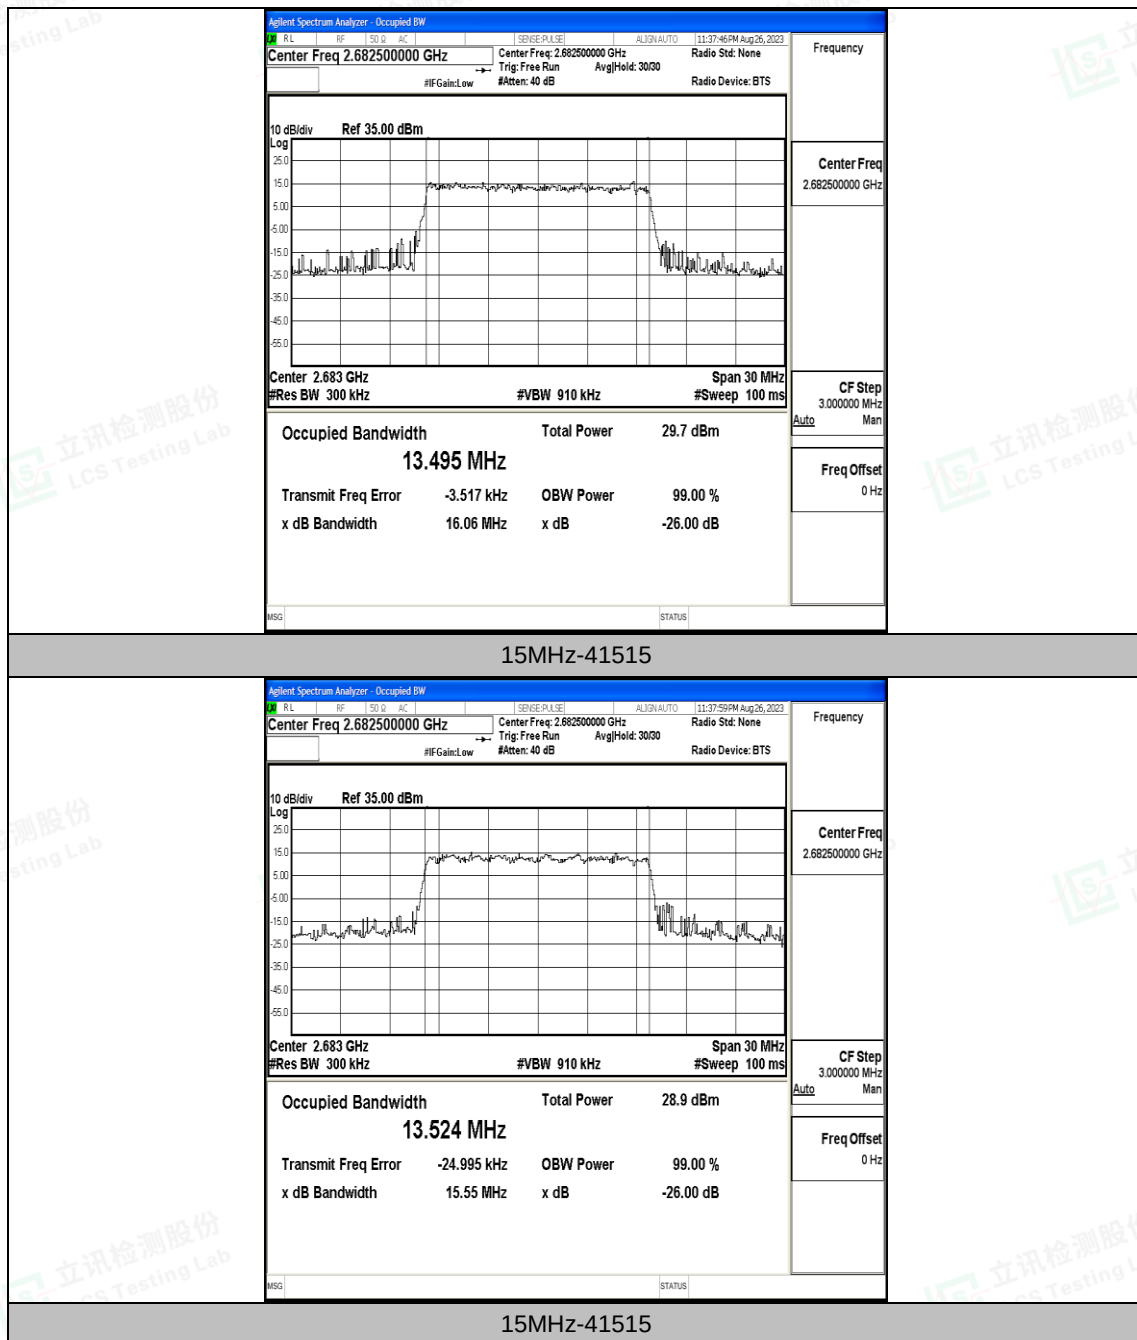

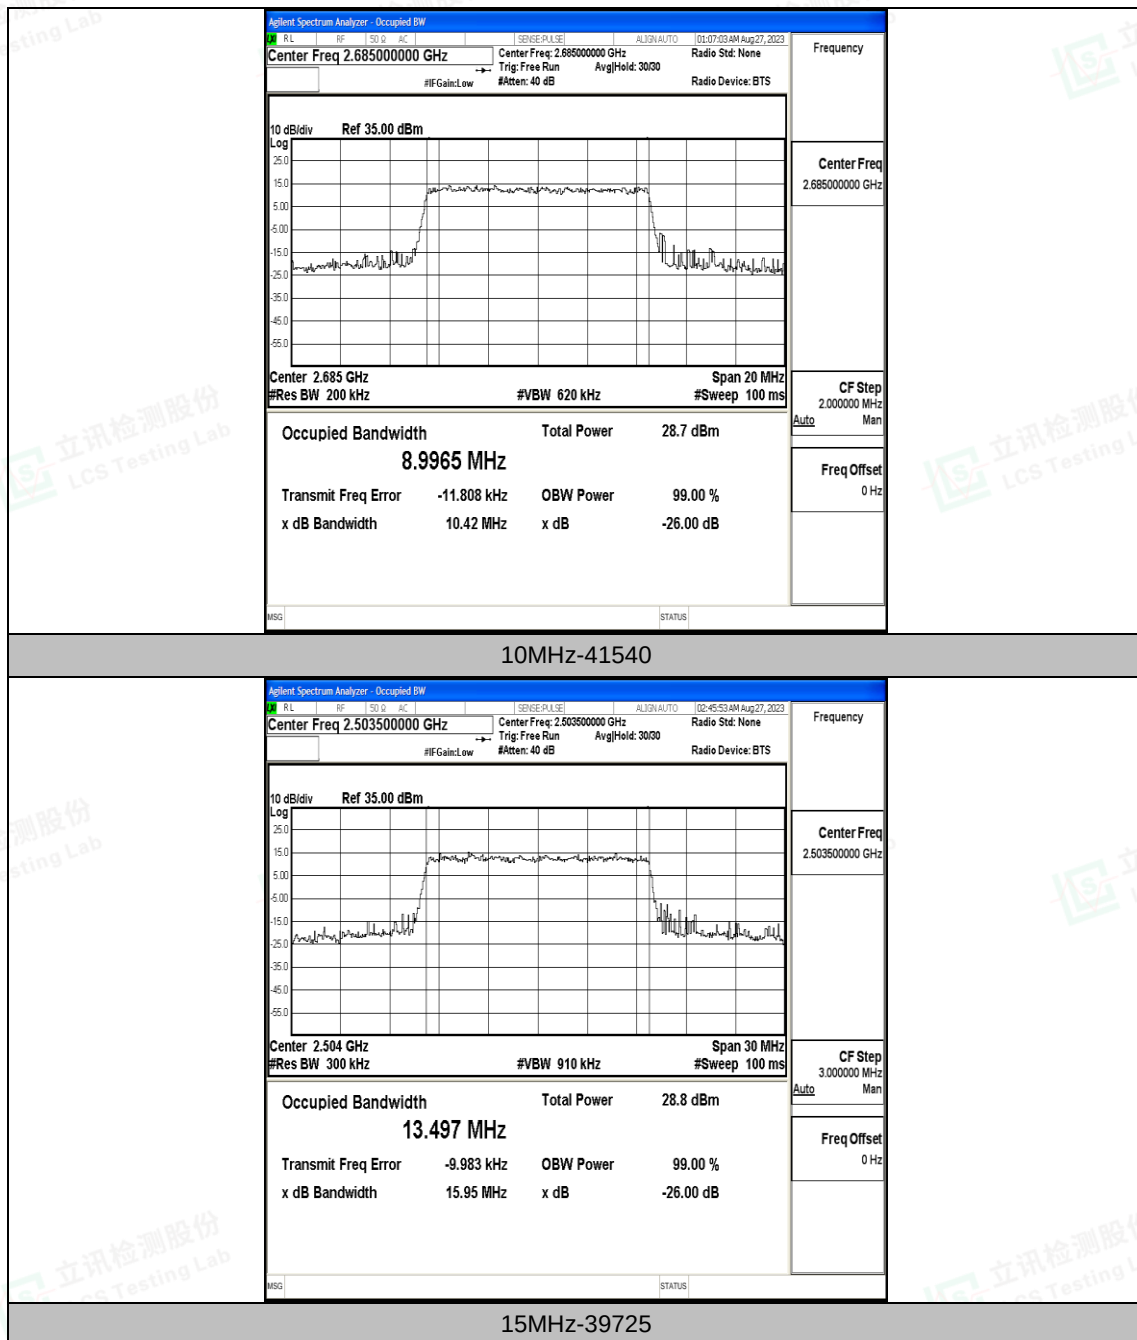


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

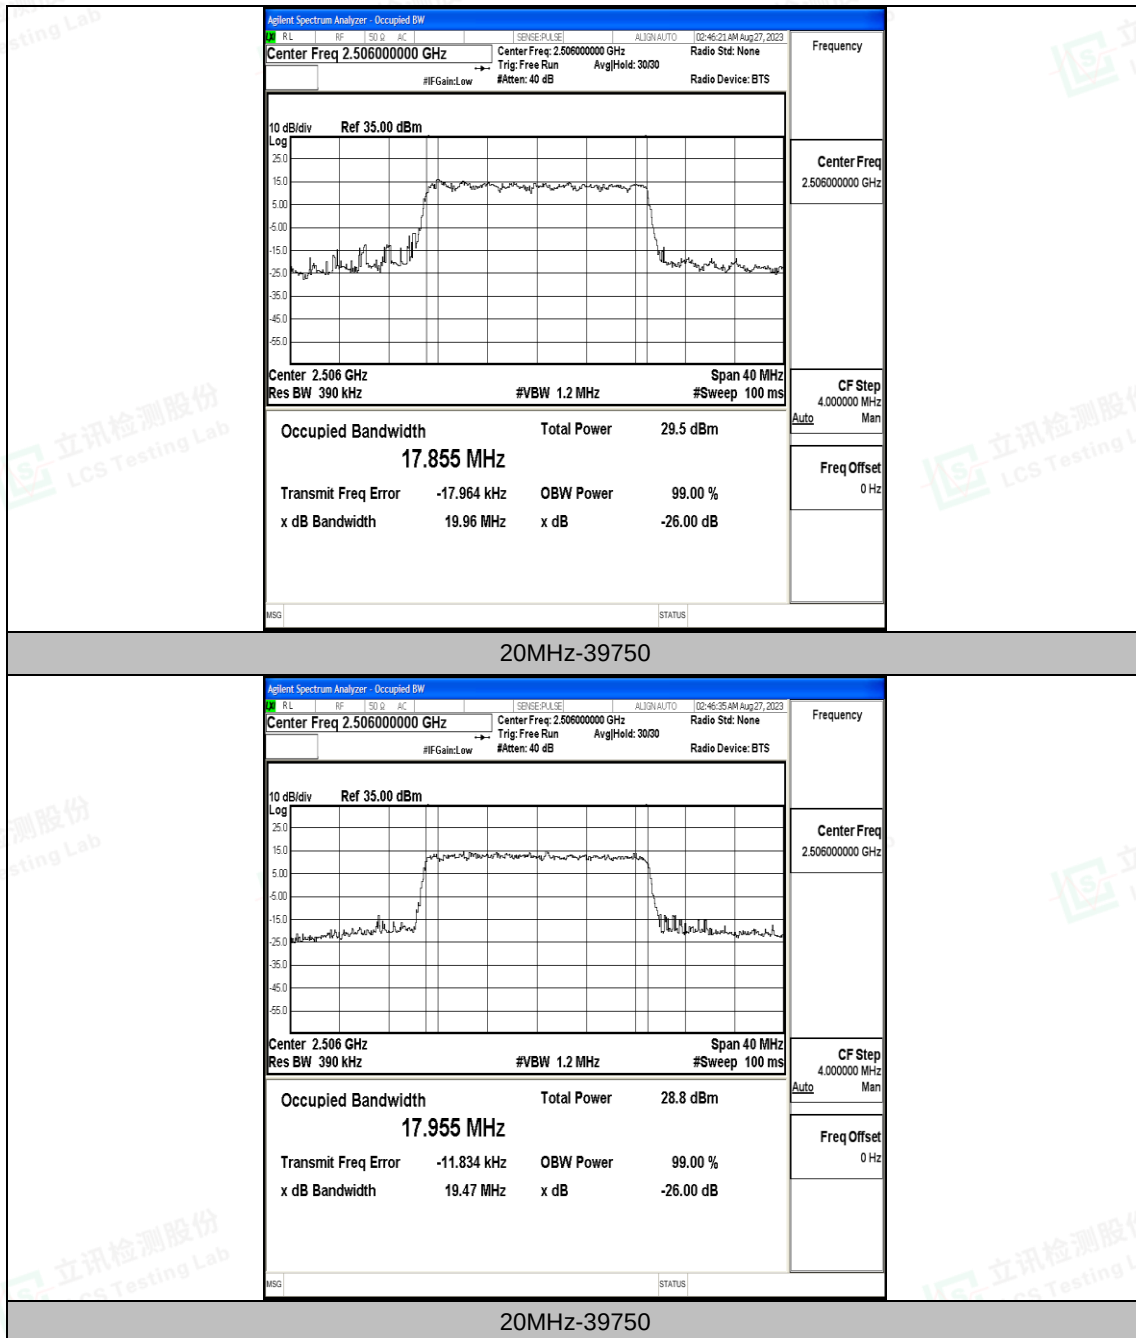

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity





N.4 Band Edge


Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Peak Frequency	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	2494.62	-32.52	PASS
Band41	5MHz	16QAM	39675	25RB#0	2494.80	-30.84	PASS
Band41	5MHz	QPSK	41565	25RB#0	2696.10	-41.39	PASS
Band41	5MHz	16QAM	41565	25RB#0	2696.03	-42.14	PASS
Band41	15MHz	QPSK	39725	75RB#0	2489.54	-33.79	PASS
Band41	15MHz	16QAM	39725	75RB#0	2489.54	-33.32	PASS
Band41	15MHz	QPSK	41515	75RB#0	2705.38	-37.28	PASS
Band41	15MHz	16QAM	41515	75RB#0	2705.35	-36.61	PASS
Band41	20MHz	QPSK	39750	100RB#0	2490.24	-34.77	PASS
Band41	20MHz	16QAM	39750	100RB#0	2490.07	-33.59	PASS
Band41	20MHz	QPSK	41490	100RB#0	2710.73	-40.10	PASS
Band41	20MHz	16QAM	41490	100RB#0	2710.10	-38.66	PASS
Band41	10MHz	QPSK	39700	50RB#0	2490.47	-35.79	PASS
Band41	10MHz	16QAM	39700	50RB#0	2490.45	-35.92	PASS
Band41	10MHz	QPSK	41540	50RB#0	2700.68	-40.81	PASS
Band41	10MHz	16QAM	41540	50RB#0	2700.05	-38.75	PASS








Test Graphs

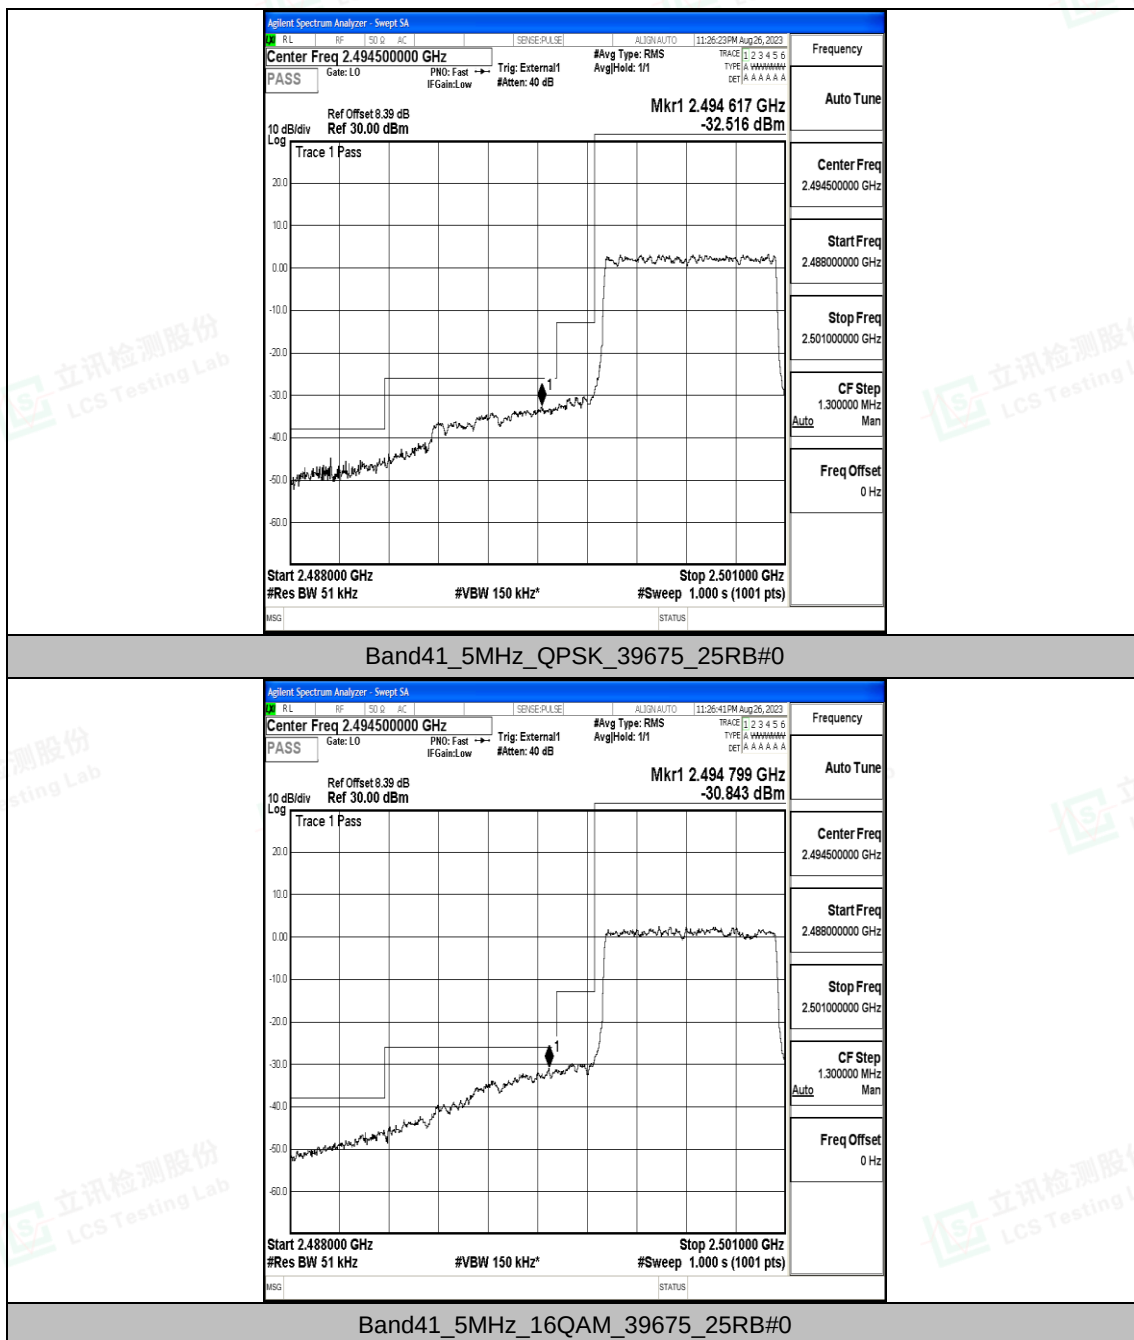


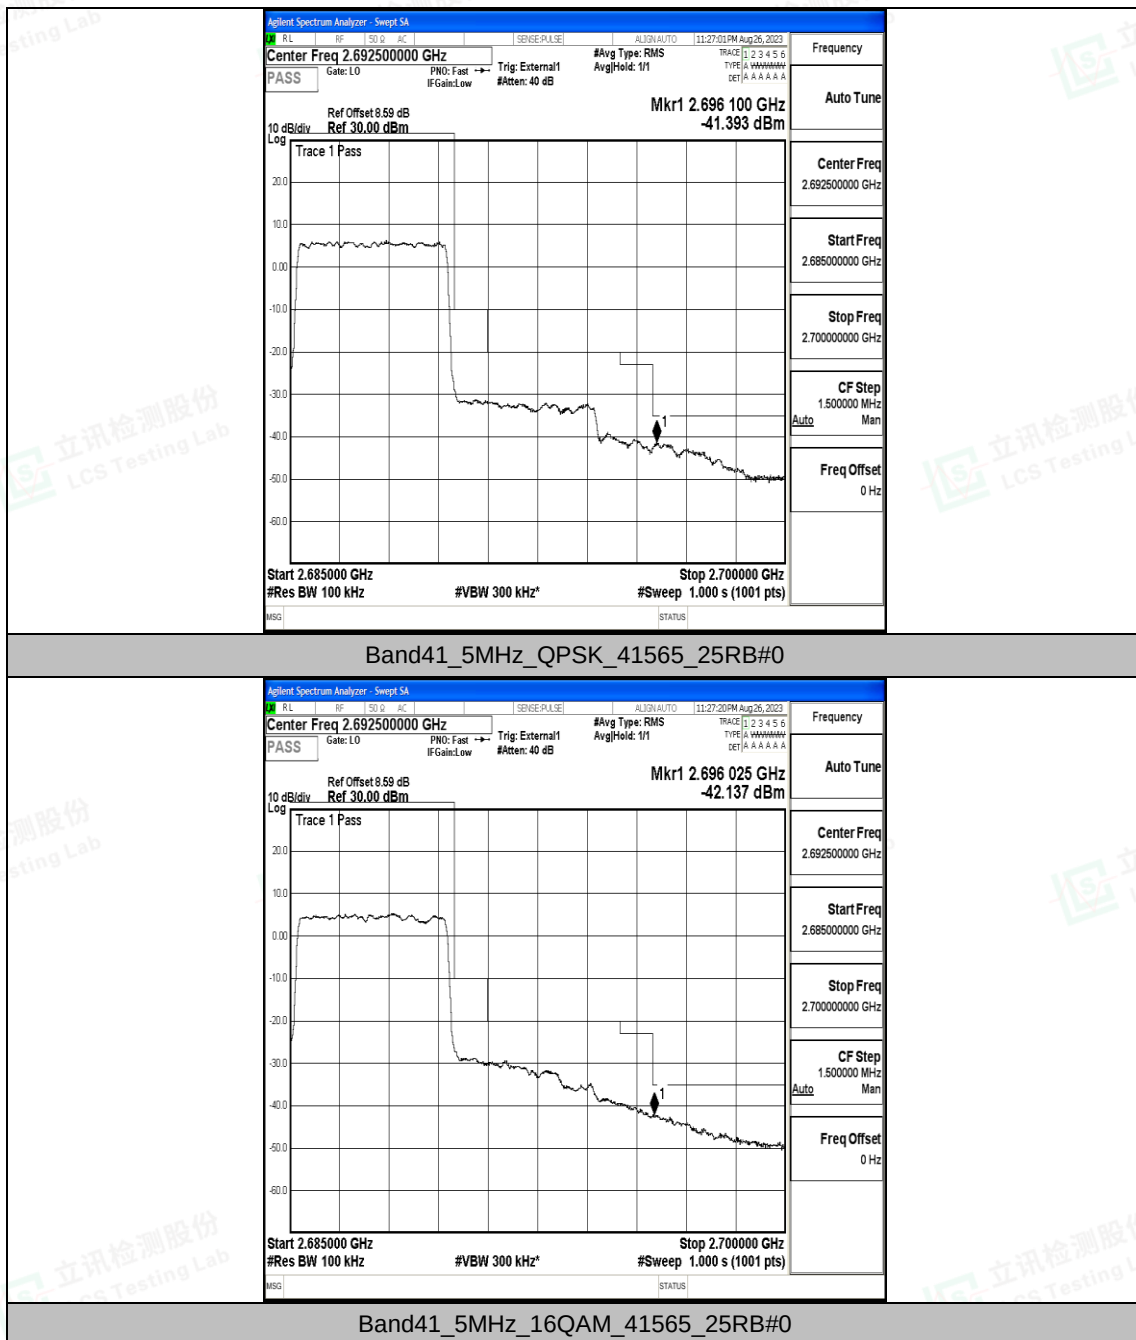

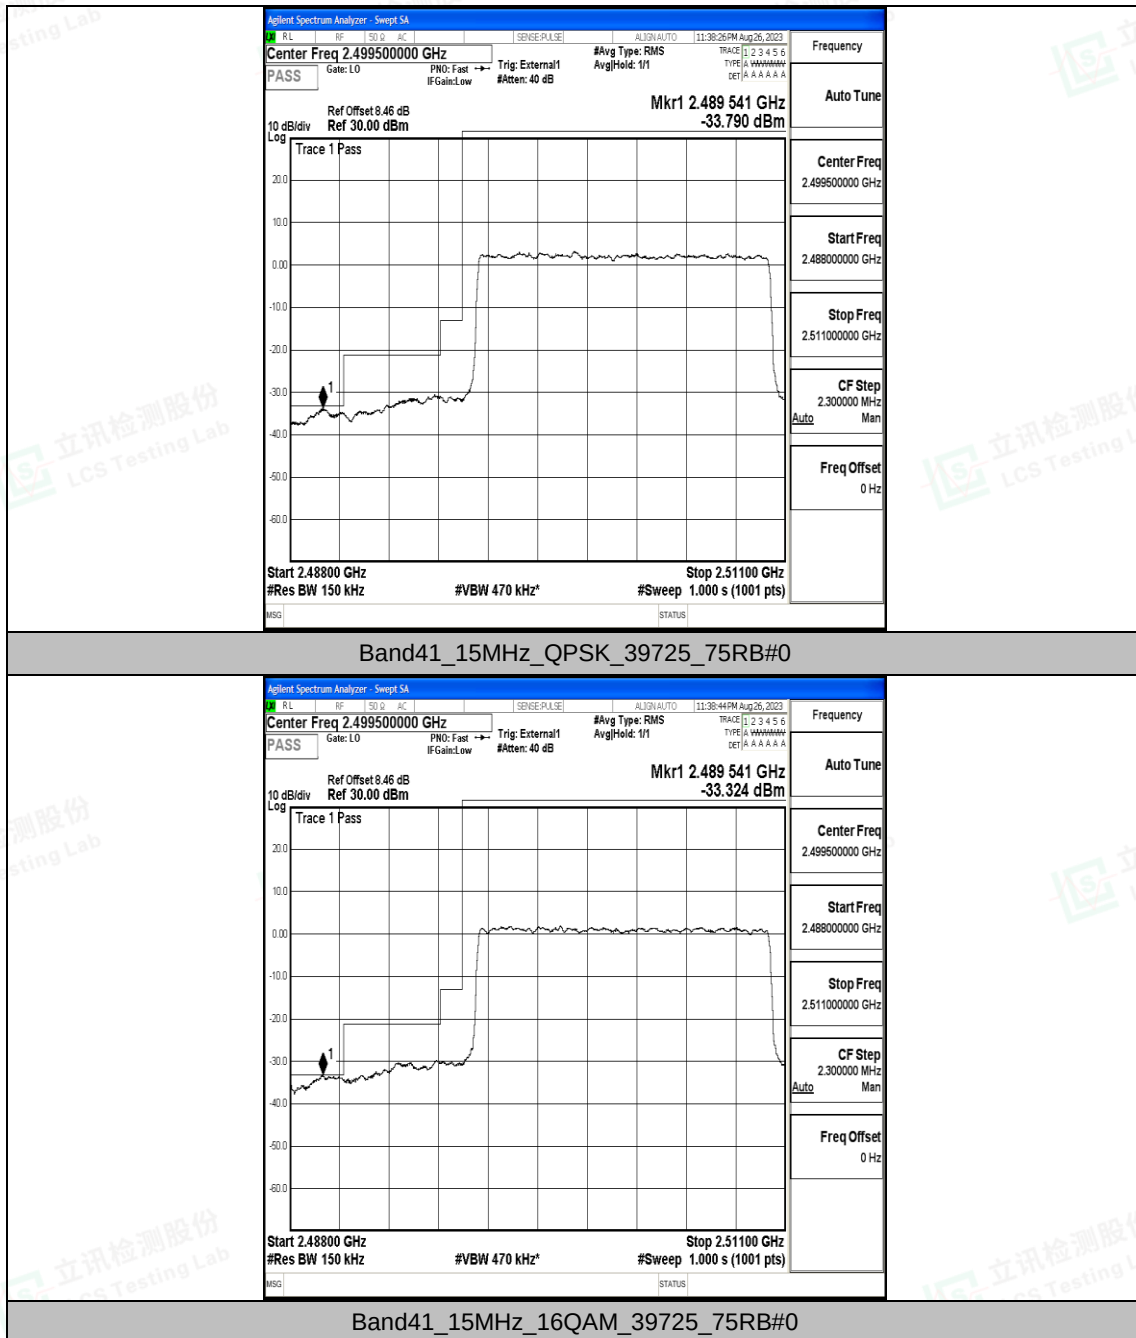


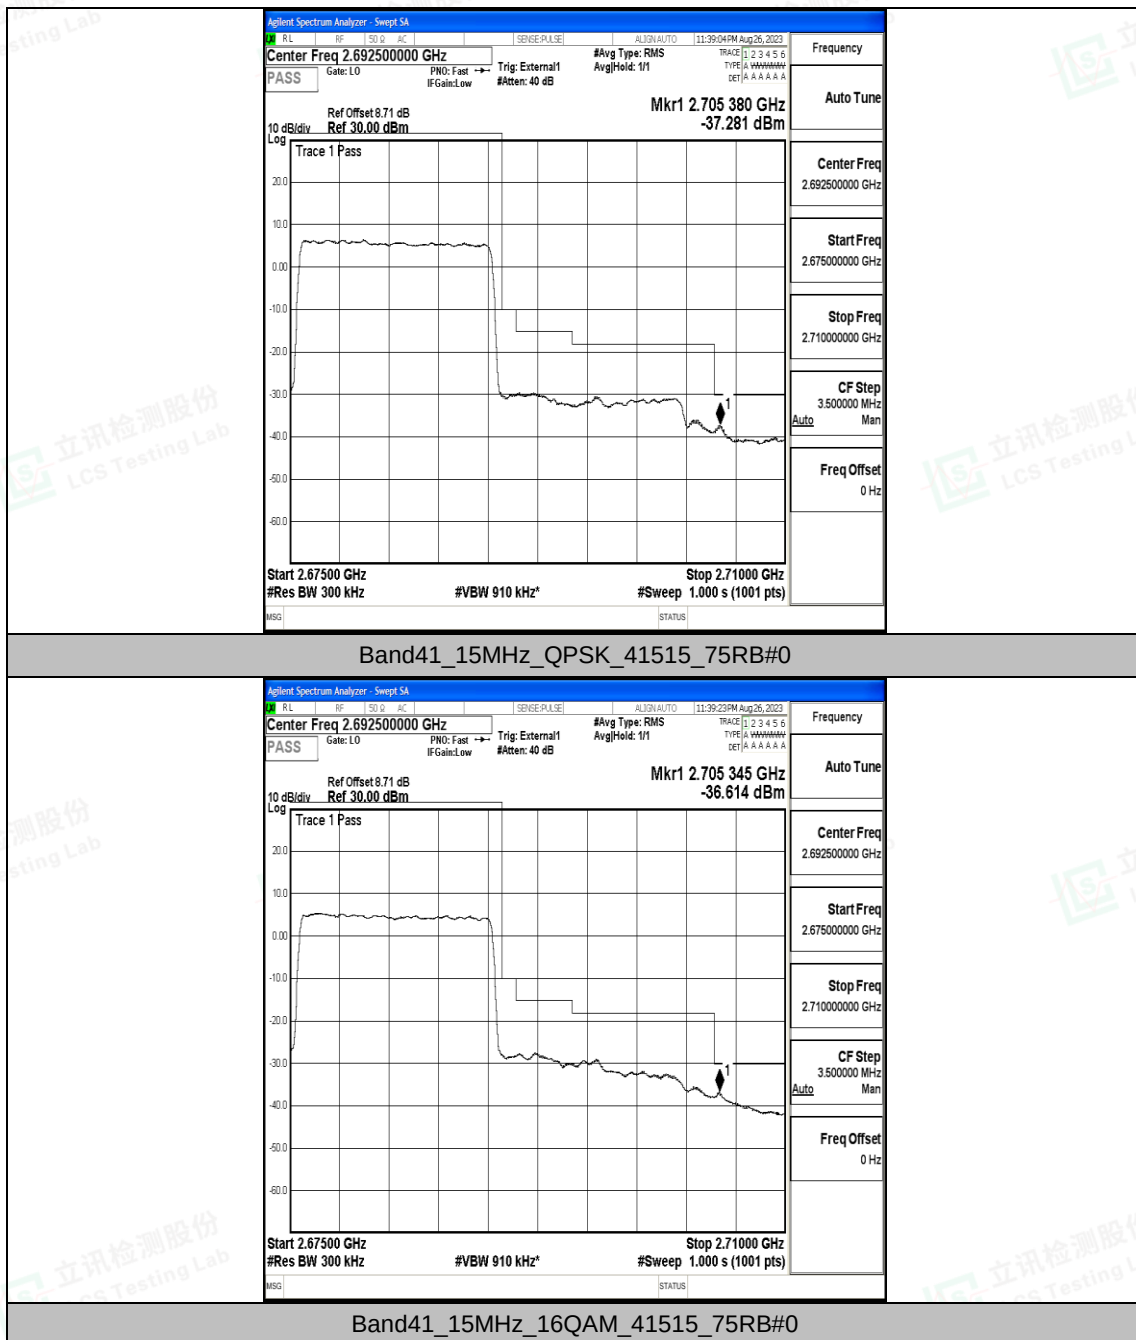

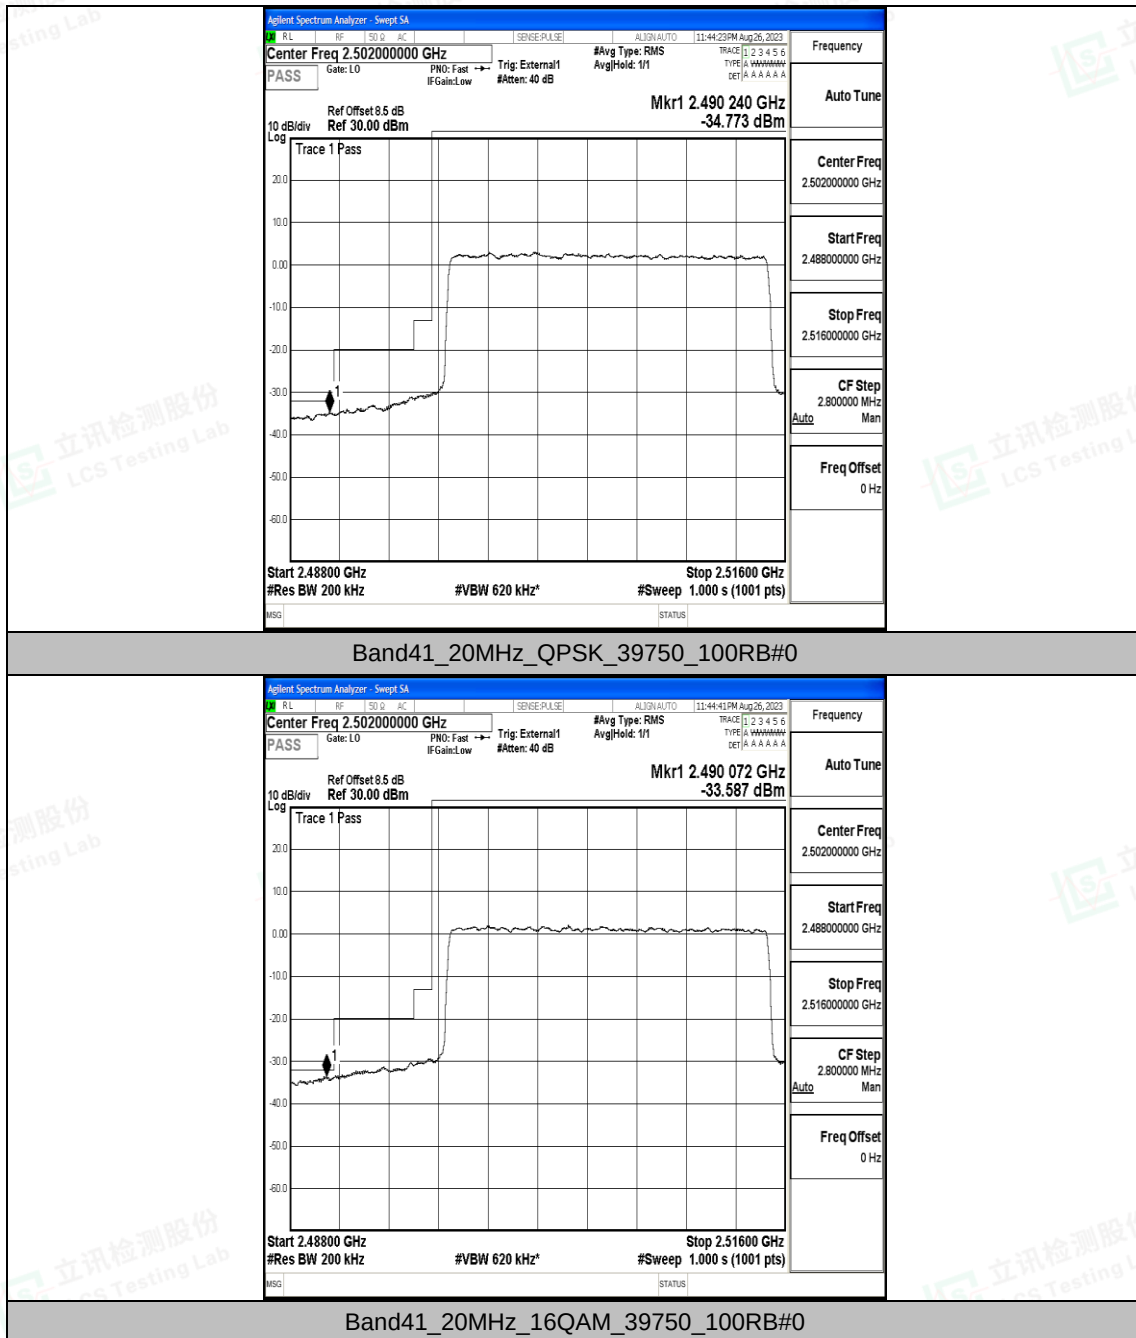

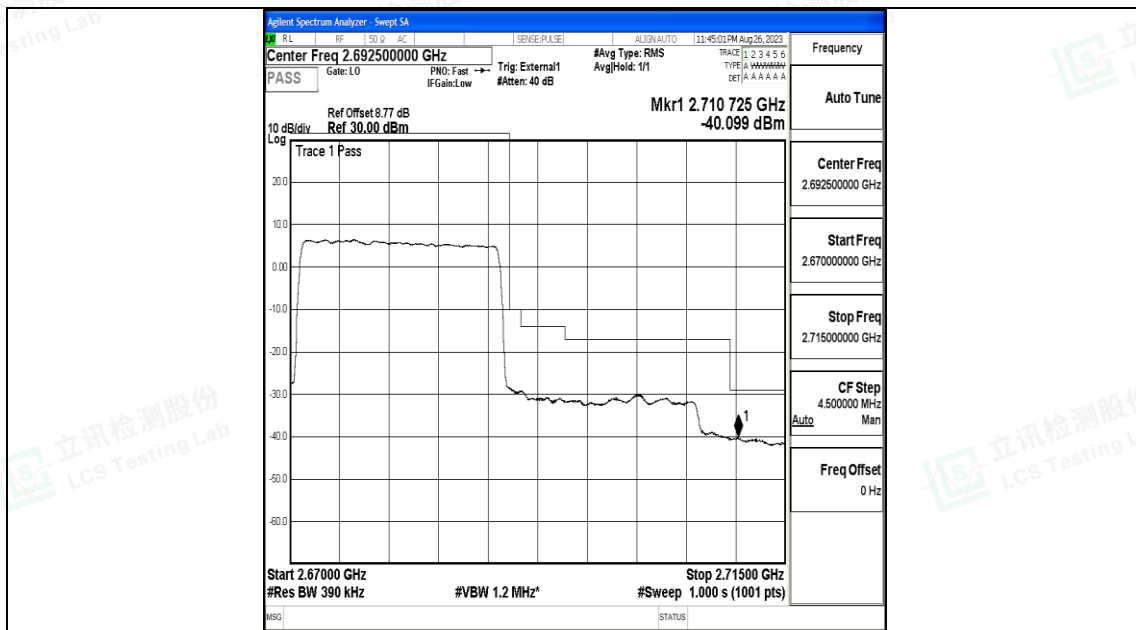

Band41_20MHz_QPSK_41490_100RB#0

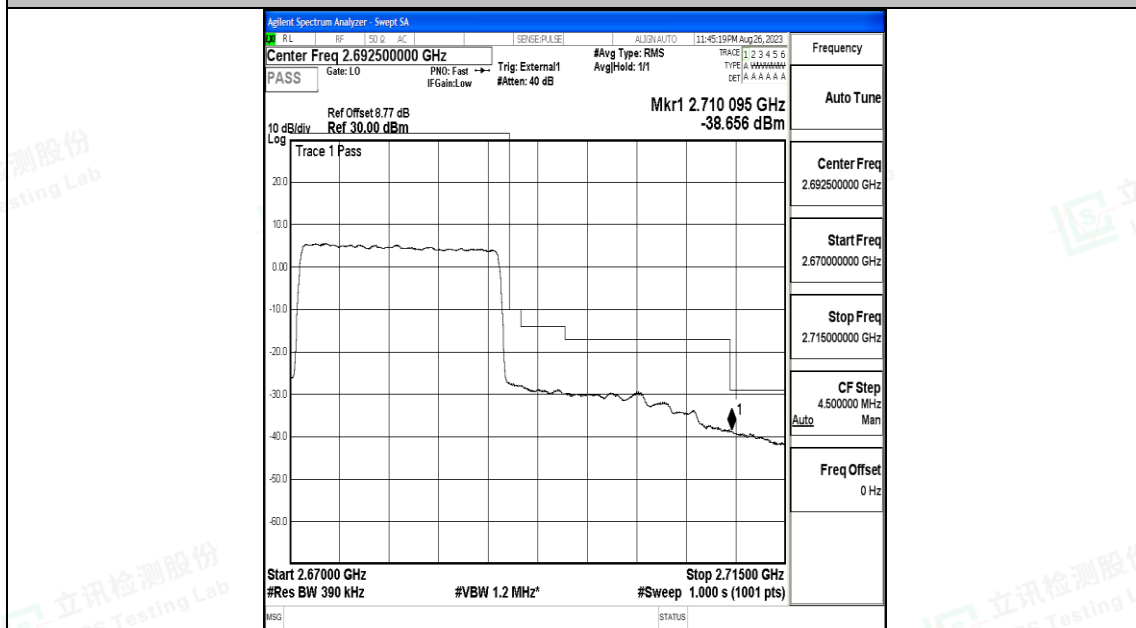

Band41_20MHz_16QAM_41490_100RB#0





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

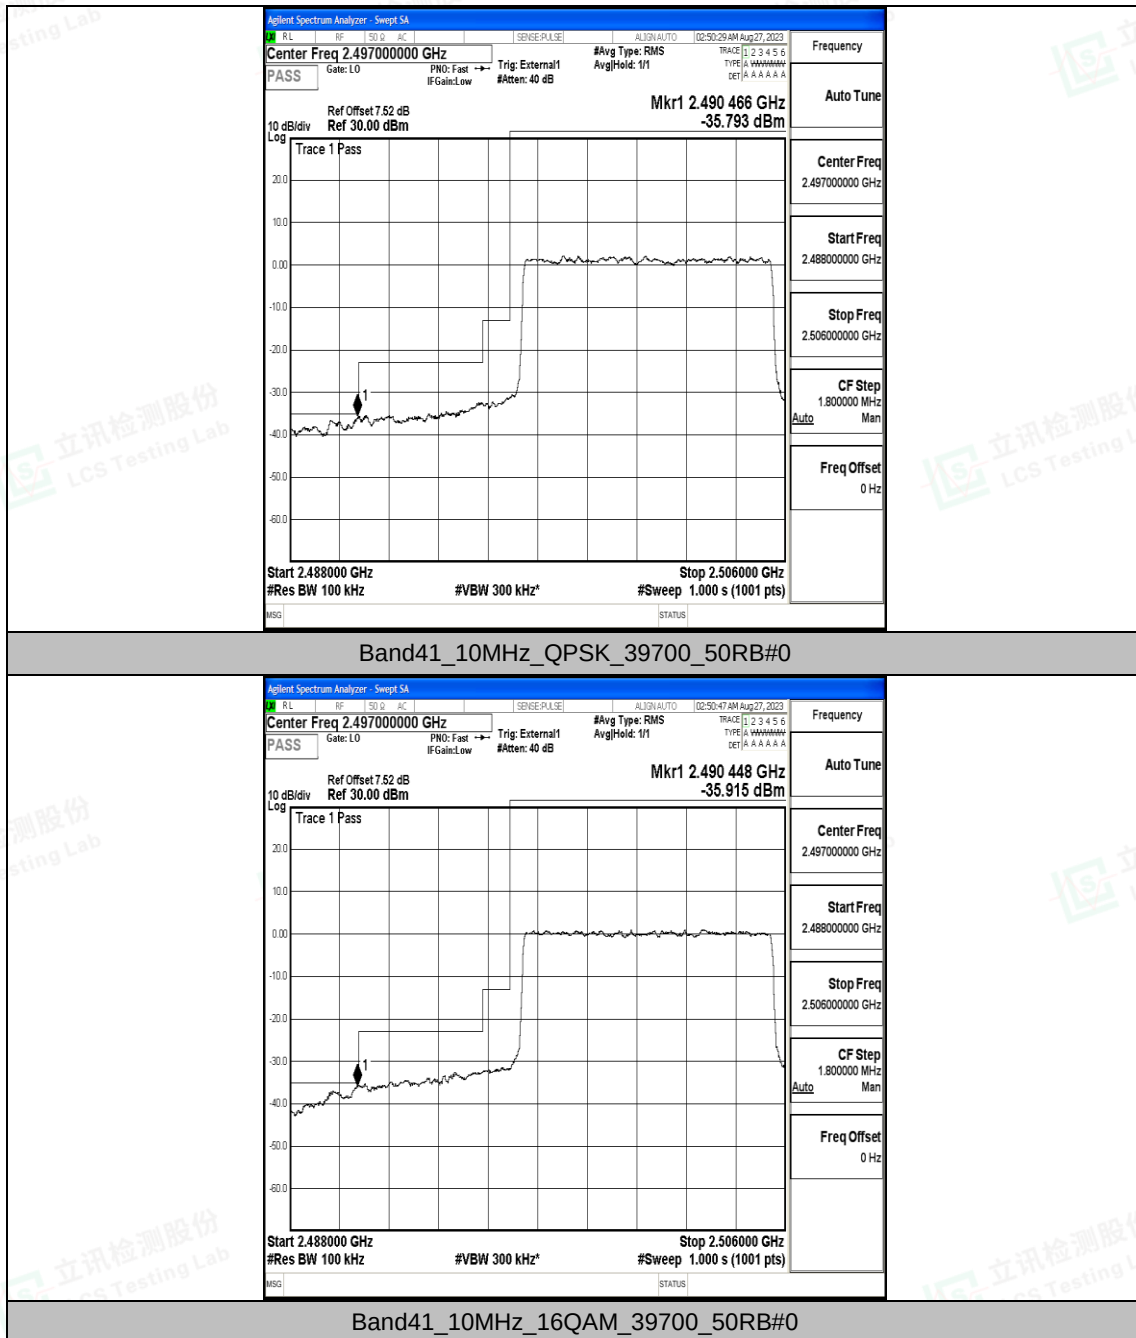

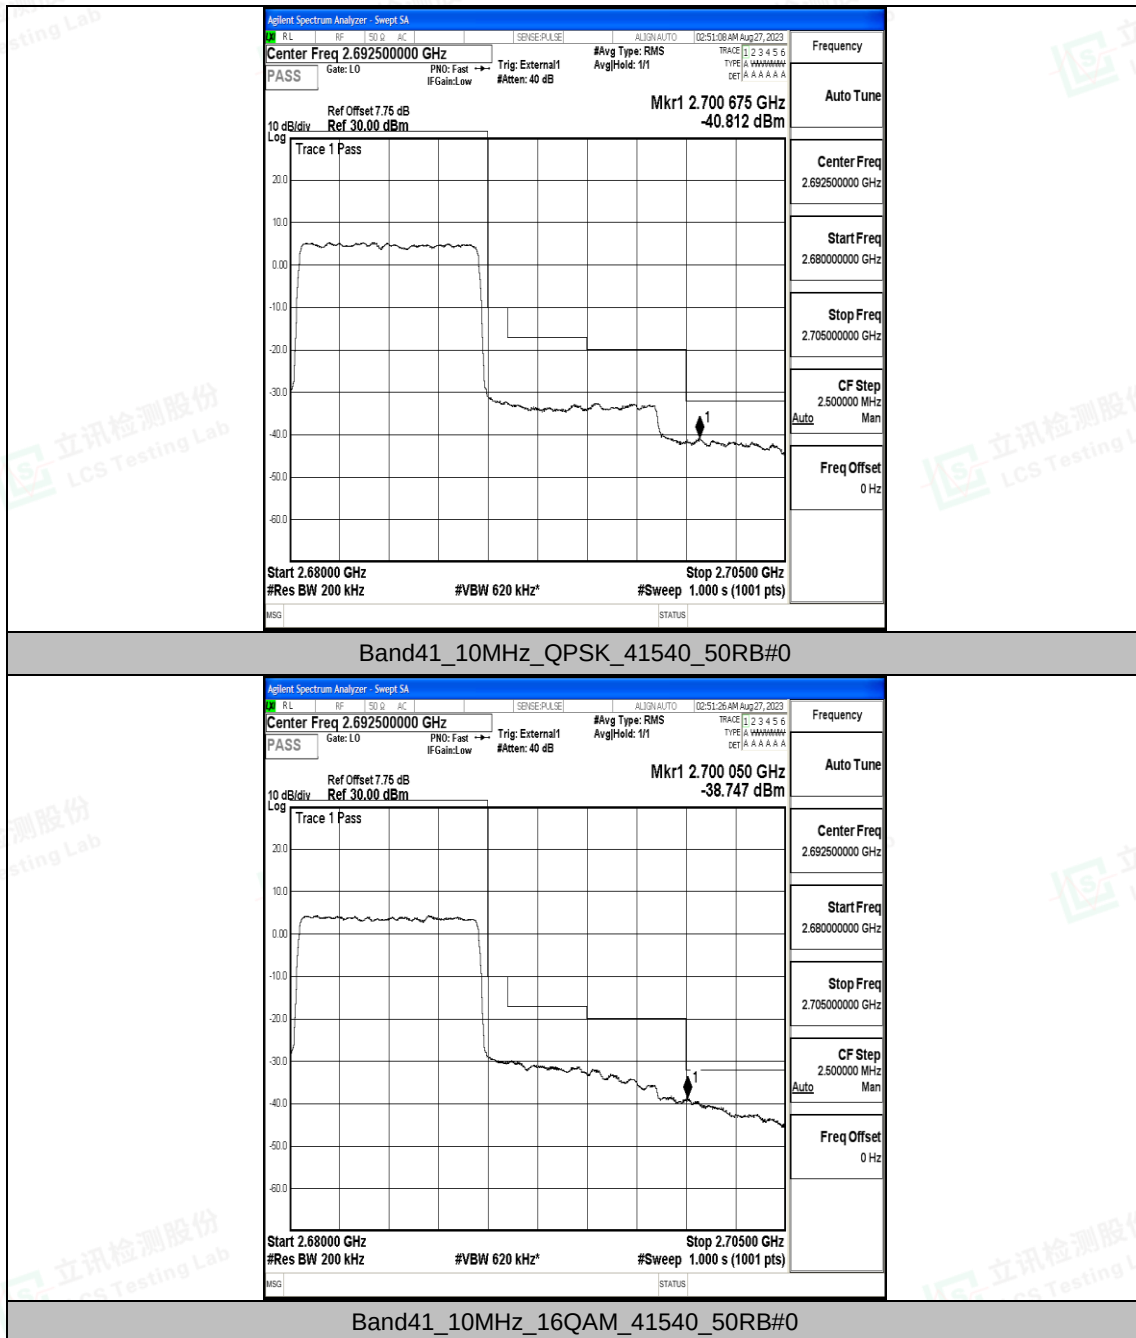



N.5 Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	0.15~30	-51.31	PASS
Band41	5MHz	QPSK	39675	1RB#0	30~1000	-53.94	PASS
Band41	5MHz	QPSK	39675	1RB#0	1000~20000	-33.54	PASS
Band41	5MHz	QPSK	39675	1RB#0	20000~27000	-45.50	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.009~0.15	-69.32	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.15~30	-51.41	PASS
Band41	5MHz	16QAM	39675	1RB#0	30~1000	-53.95	PASS
Band41	5MHz	16QAM	39675	1RB#0	1000~20000	-33.26	PASS
Band41	5MHz	16QAM	39675	1RB#0	20000~27000	-45.72	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.009~0.15	-69.94	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.15~30	-50.84	PASS
Band41	5MHz	QPSK	40620	1RB#0	30~1000	-52.42	PASS
Band41	5MHz	QPSK	40620	1RB#0	1000~20000	-33.40	PASS
Band41	5MHz	QPSK	40620	1RB#0	20000~27000	-45.08	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.009~0.15	-68.82	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.15~30	-50.92	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.009~0.15	-68.72	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.15~30	-49.70	PASS
Band41	5MHz	16QAM	40620	1RB#0	30~1000	-51.53	PASS
Band41	5MHz	16QAM	40620	1RB#0	1000~20000	-33.89	PASS
Band41	5MHz	16QAM	40620	1RB#0	20000~27000	-46.50	PASS
Band41	5MHz	QPSK	41565	1RB#0	30~1000	-53.75	PASS
Band41	5MHz	QPSK	41565	1RB#0	1000~20000	-33.50	PASS
Band41	5MHz	QPSK	41565	1RB#0	20000~27000	-45.38	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.009~0.15	-69.03	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.15~30	-51.01	PASS
Band41	5MHz	16QAM	41565	1RB#0	30~1000	-54.00	PASS
Band41	5MHz	16QAM	41565	1RB#0	1000~20000	-33.21	PASS
Band41	5MHz	16QAM	41565	1RB#0	20000~27000	-45.33	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.009~0.15	-69.35	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.15~30	-52.29	PASS
Band41	10MHz	QPSK	39700	1RB#0	30~1000	-53.82	PASS
Band41	10MHz	QPSK	39700	1RB#0	1000~20000	-33.24	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	QPSK	39700	1RB#0	20000~27000	-44.81	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.15~30	-51.30	PASS
Band41	10MHz	16QAM	39700	1RB#0	30~1000	-53.71	PASS
Band41	10MHz	16QAM	39700	1RB#0	1000~20000	-33.52	PASS
Band41	10MHz	16QAM	39700	1RB#0	20000~27000	-45.73	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.009~0.15	-67.44	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.15~30	-50.28	PASS
Band41	10MHz	QPSK	40620	1RB#0	30~1000	-53.85	PASS
Band41	10MHz	QPSK	40620	1RB#0	1000~20000	-33.51	PASS
Band41	10MHz	QPSK	40620	1RB#0	20000~27000	-45.74	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.009~0.15	-68.14	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.15~30	-52.88	PASS
Band41	10MHz	16QAM	40620	1RB#0	30~1000	-53.83	PASS
Band41	10MHz	16QAM	40620	1RB#0	1000~20000	-33.27	PASS
Band41	10MHz	16QAM	40620	1RB#0	20000~27000	-45.35	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.009~0.15	-68.16	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.15~30	-51.99	PASS
Band41	10MHz	QPSK	41540	1RB#0	1000~20000	-33.33	PASS
Band41	10MHz	QPSK	41540	1RB#0	20000~27000	-45.63	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.009~0.15	-68.79	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.15~30	-51.58	PASS
Band41	10MHz	16QAM	41540	1RB#0	30~1000	-53.81	PASS
Band41	10MHz	16QAM	41540	1RB#0	1000~20000	-33.38	PASS
Band41	10MHz	16QAM	41540	1RB#0	20000~27000	-44.99	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.009~0.15	-66.23	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.15~30	-50.01	PASS
Band41	15MHz	QPSK	39725	1RB#0	30~1000	-53.82	PASS
Band41	15MHz	QPSK	39725	1RB#0	1000~20000	-33.22	PASS
Band41	15MHz	QPSK	39725	1RB#0	20000~27000	-45.60	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.009~0.15	-66.84	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.15~30	-51.18	PASS
Band41	15MHz	16QAM	39725	1RB#0	30~1000	-53.76	PASS
Band41	15MHz	16QAM	39725	1RB#0	1000~20000	-33.39	PASS
Band41	15MHz	16QAM	39725	1RB#0	20000~27000	-45.56	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.009~0.15	-66.87	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.15~30	-52.96	PASS
Band41	15MHz	QPSK	40620	1RB#0	30~1000	-53.82	PASS
Band41	15MHz	QPSK	40620	1RB#0	20000~27000	-45.45	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.009~0.15	-67.69	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	16QAM	40620	1RB#0	0.15~30	-53.73	PASS
Band41	15MHz	16QAM	40620	1RB#0	30~1000	-53.85	PASS
Band41	15MHz	16QAM	40620	1RB#0	1000~20000	-33.01	PASS
Band41	15MHz	16QAM	40620	1RB#0	20000~27000	-45.23	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.009~0.15	-67.09	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.15~30	-50.93	PASS
Band41	15MHz	QPSK	41515	1RB#0	30~1000	-53.42	PASS
Band41	15MHz	QPSK	41515	1RB#0	1000~20000	-33.49	PASS
Band41	15MHz	QPSK	41515	1RB#0	20000~27000	-45.62	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.009~0.15	-67.66	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.15~30	-50.31	PASS
Band41	15MHz	16QAM	41515	1RB#0	30~1000	-53.90	PASS
Band41	15MHz	16QAM	41515	1RB#0	1000~20000	-33.37	PASS
Band41	15MHz	16QAM	41515	1RB#0	20000~27000	-45.39	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.009~0.15	-69.28	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.15~30	-51.84	PASS
Band41	20MHz	QPSK	39750	1RB#0	30~1000	-53.98	PASS
Band41	20MHz	QPSK	39750	1RB#0	1000~20000	-33.36	PASS
Band41	20MHz	QPSK	39750	1RB#0	20000~27000	-45.09	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.009~0.15	-68.91	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.15~30	-51.06	PASS
Band41	20MHz	16QAM	39750	1RB#0	30~1000	-53.84	PASS
Band41	20MHz	16QAM	39750	1RB#0	1000~20000	-33.24	PASS
Band41	20MHz	16QAM	39750	1RB#0	20000~27000	-45.49	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.009~0.15	-66.50	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.15~30	-51.03	PASS
Band41	20MHz	QPSK	40620	1RB#0	30~1000	-53.82	PASS
Band41	20MHz	QPSK	40620	1RB#0	1000~20000	-33.30	PASS
Band41	20MHz	QPSK	40620	1RB#0	20000~27000	-45.43	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.009~0.15	-68.92	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.15~30	-52.56	PASS
Band41	20MHz	16QAM	40620	1RB#0	30~1000	-53.89	PASS
Band41	20MHz	16QAM	40620	1RB#0	1000~20000	-33.36	PASS
Band41	20MHz	16QAM	40620	1RB#0	20000~27000	-45.36	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.009~0.15	-68.97	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.15~30	-48.85	PASS
Band41	20MHz	QPSK	41490	1RB#0	30~1000	-53.45	PASS
Band41	20MHz	QPSK	41490	1RB#0	1000~20000	-33.16	PASS
Band41	20MHz	QPSK	41490	1RB#0	20000~27000	-45.47	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Band41	20MHz	16QAM	41490	1RB#0	0.009~0.15	-67.62	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.15~30	-51.40	PASS
Band41	5MHz	QPSK	39675	1RB#0	0.009~0.15	-68.49	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.009~0.15	-67.03	PASS
Band41	10MHz	QPSK	41540	1RB#0	30~1000	-53.77	PASS
Band41	20MHz	16QAM	41490	1RB#0	30~1000	-53.96	PASS
Band41	20MHz	16QAM	41490	1RB#0	1000~20000	-33.23	PASS
Band41	20MHz	16QAM	41490	1RB#0	20000~27000	-45.41	PASS
Band41	15MHz	QPSK	40620	1RB#0	1000~20000	-33.23	PASS


Test Graphs

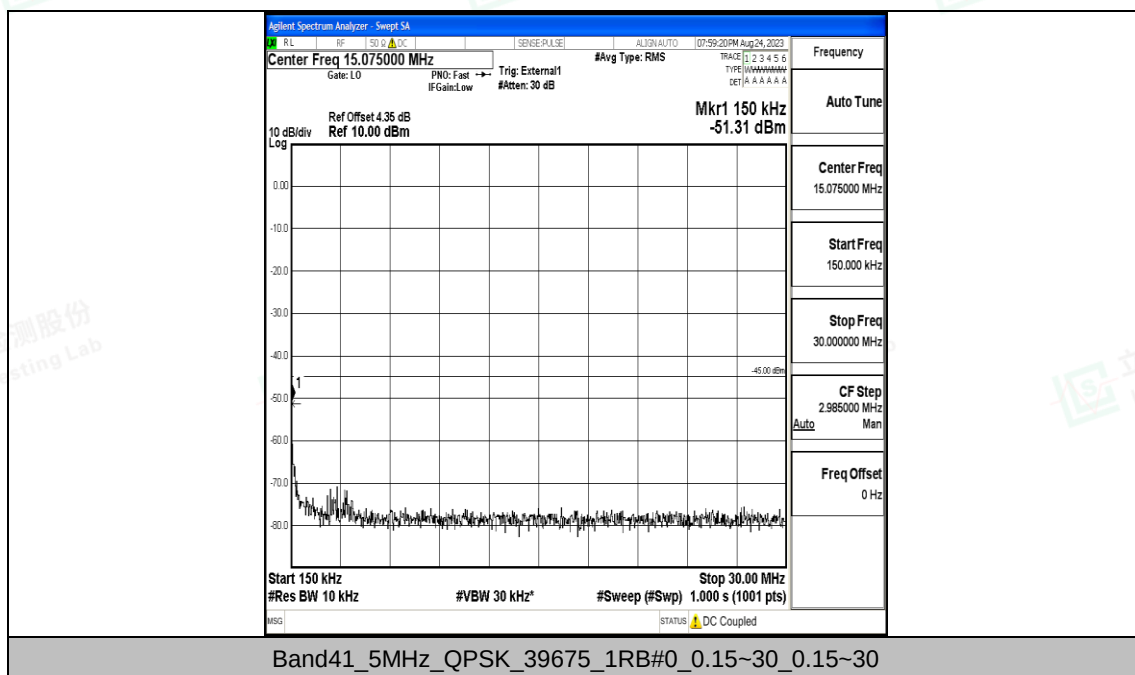

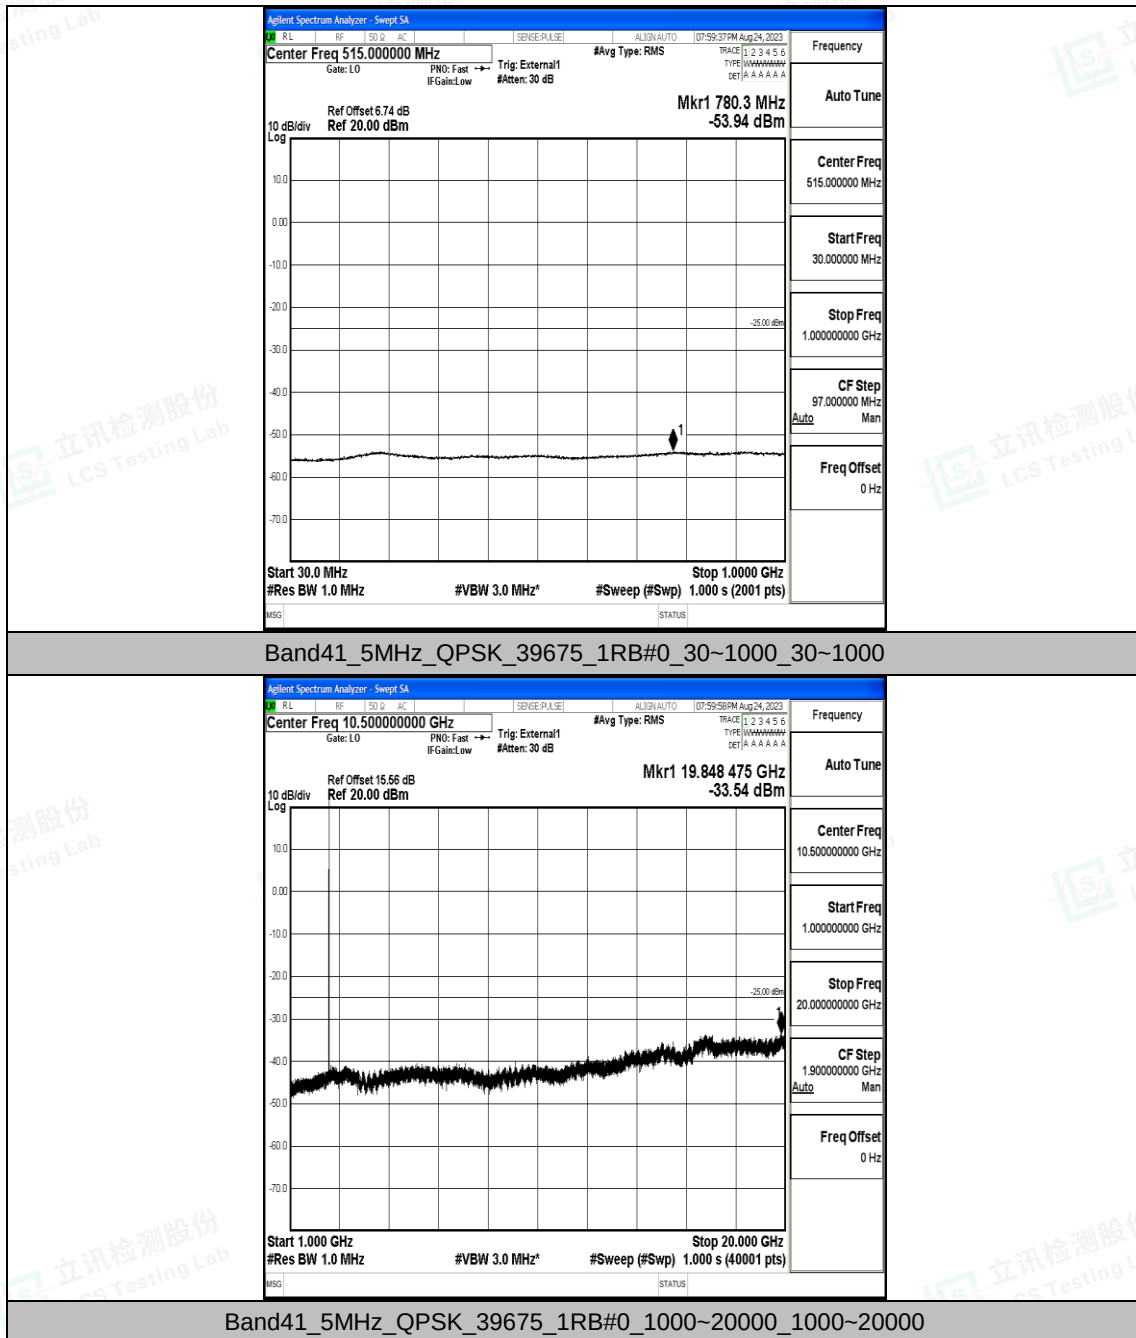

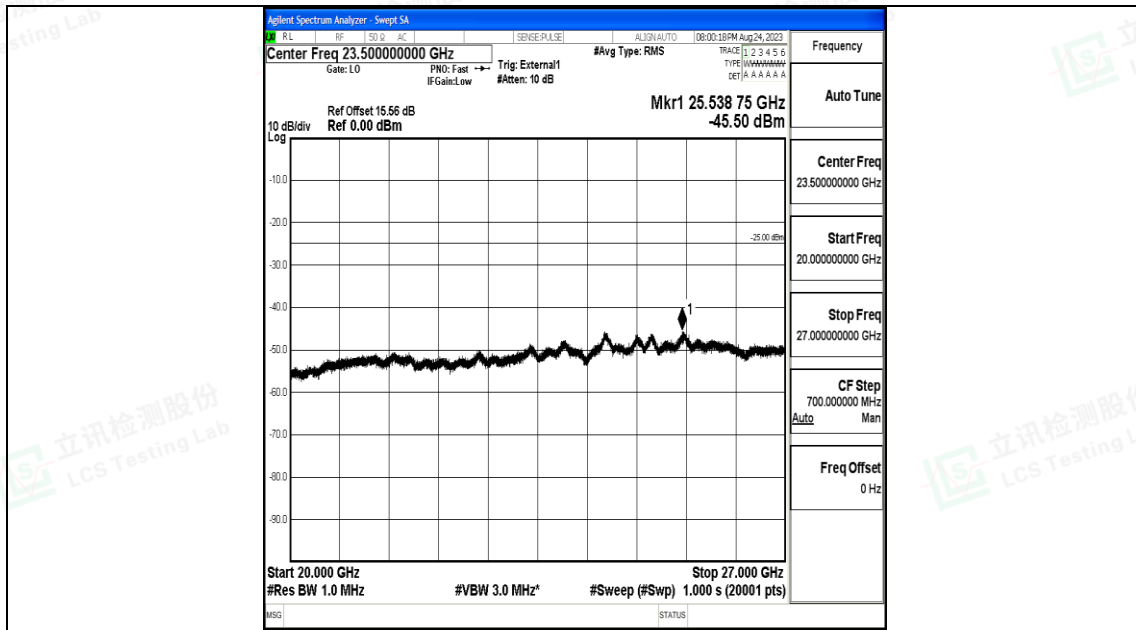



Band41_5MHz_QPSK_39675_1RB#0_20000~27000_20000~27000

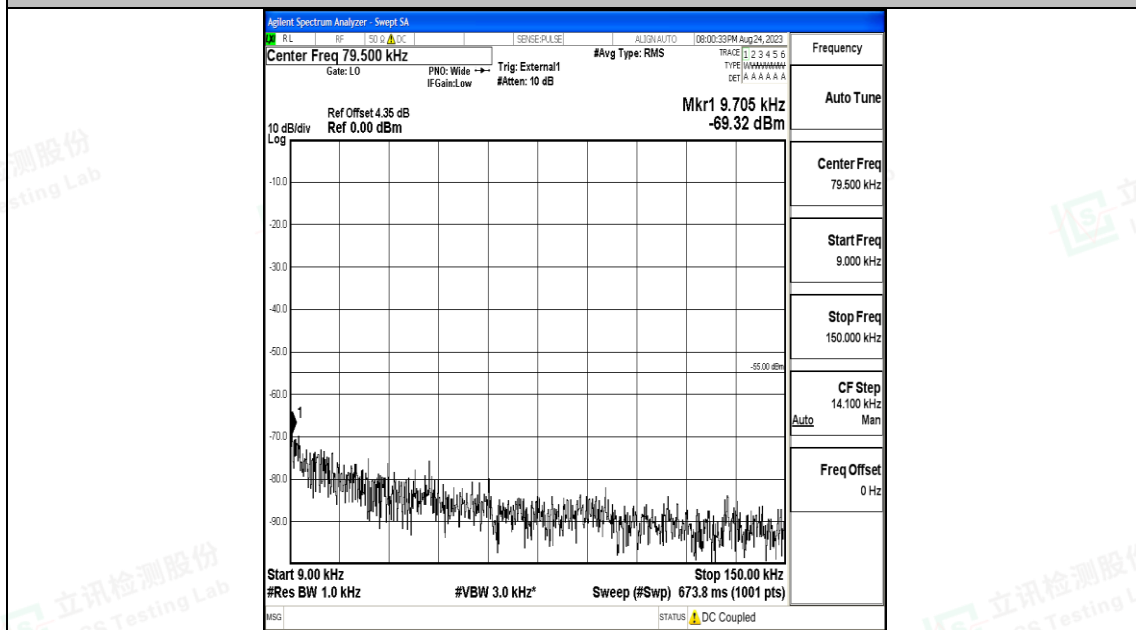


Band41_5MHz_16QAM_39675_1RB#0_0.009~0.15_0.009~0.15



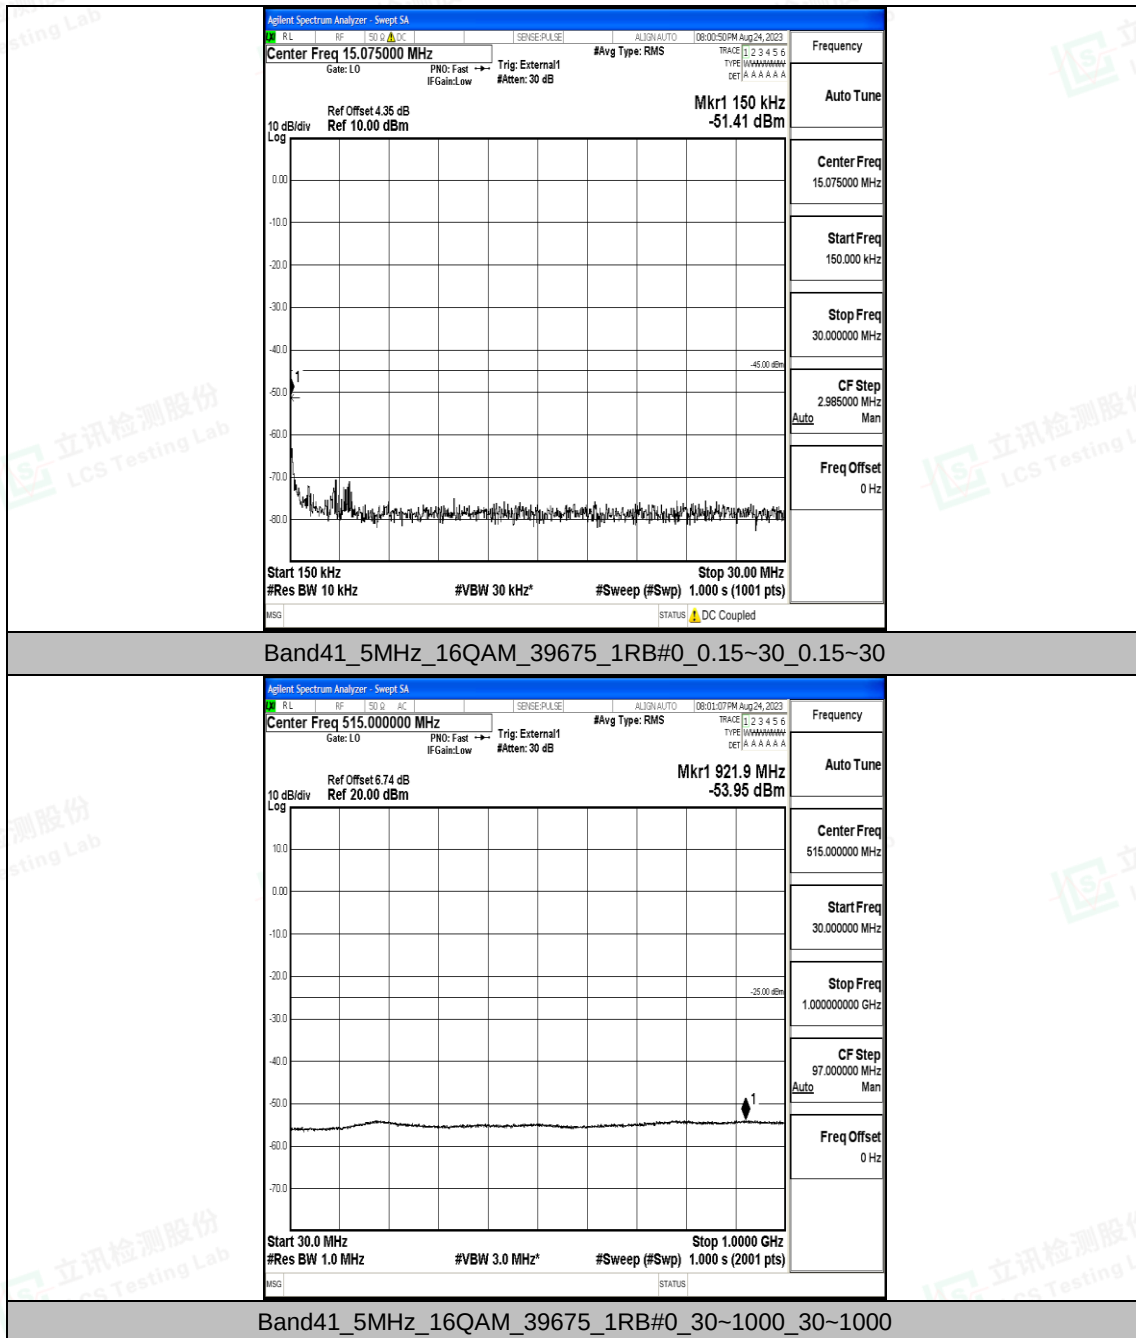

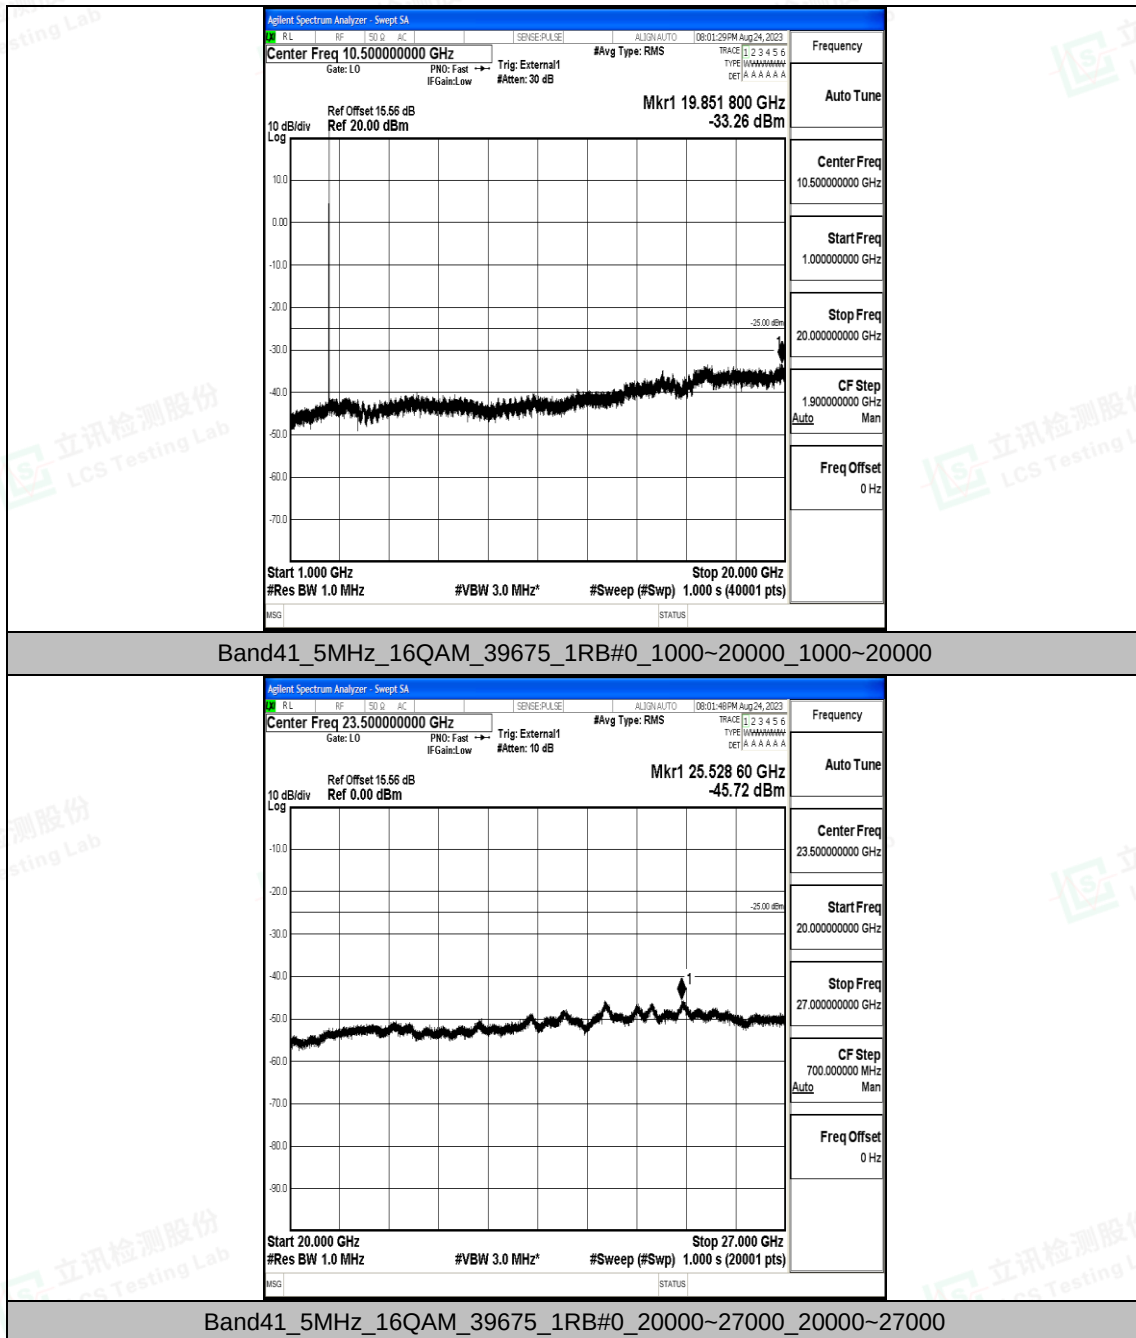

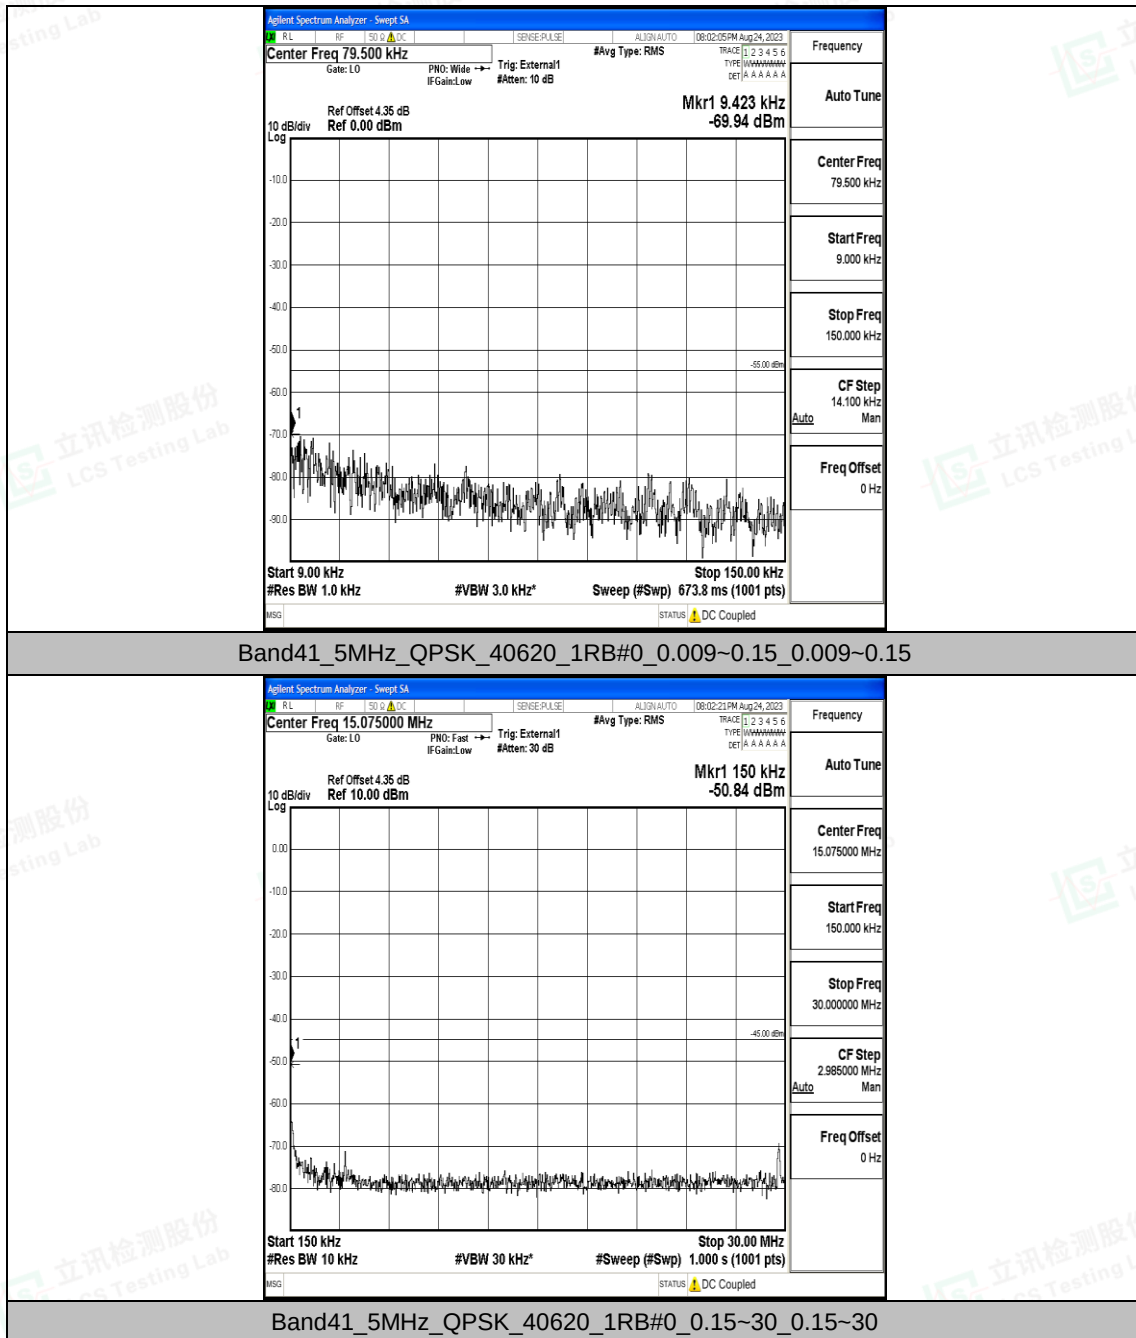



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

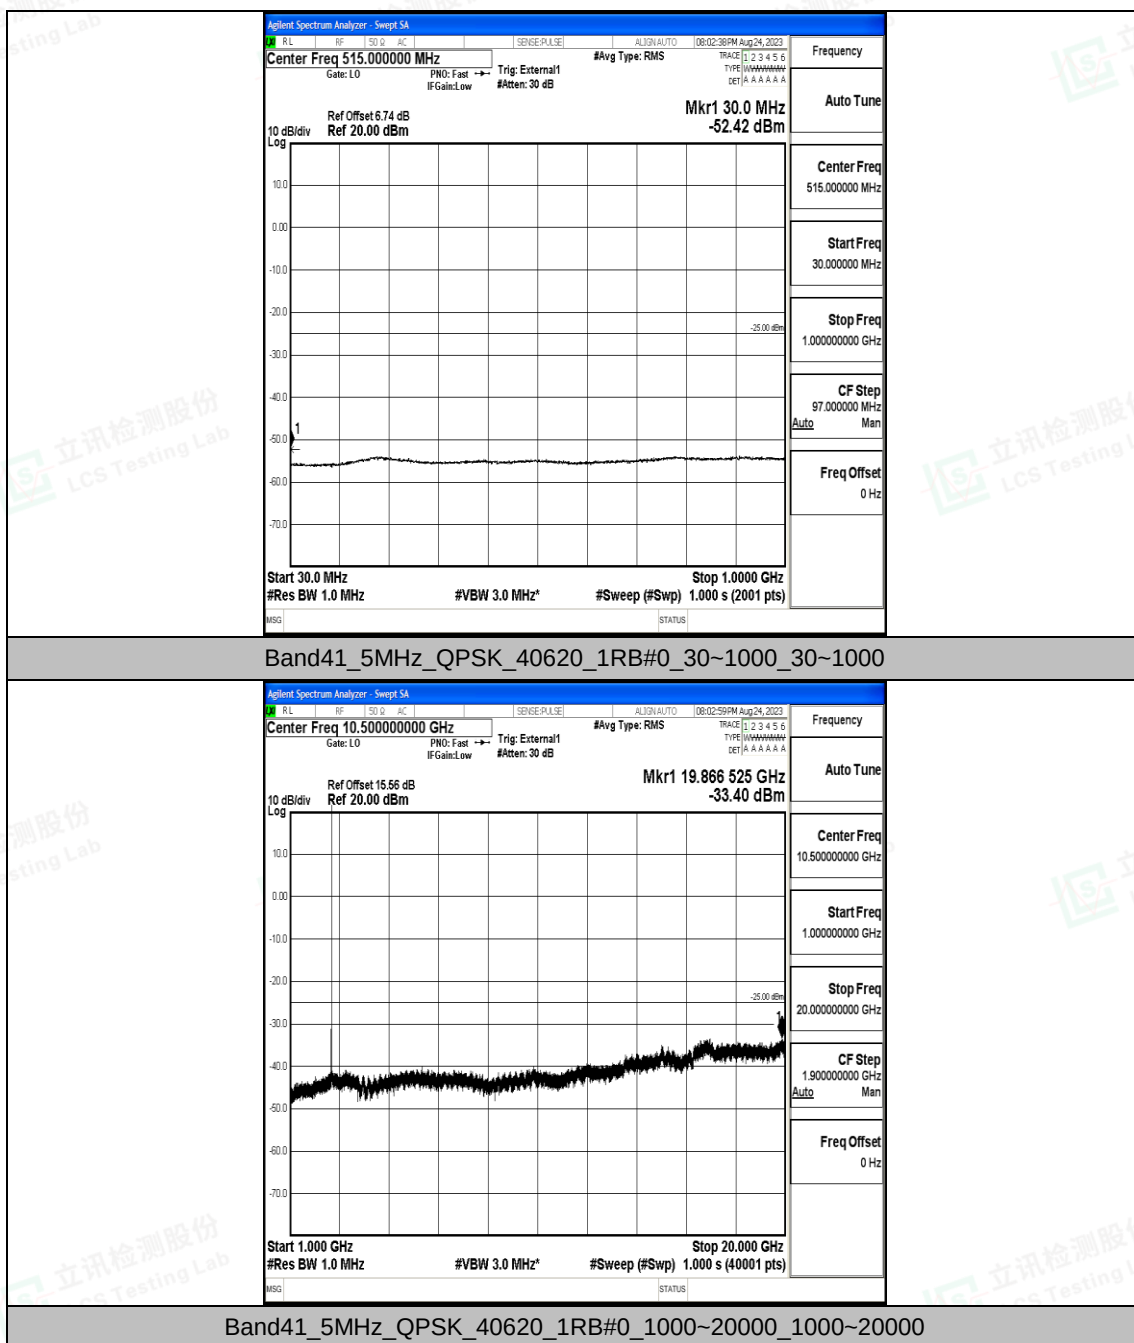

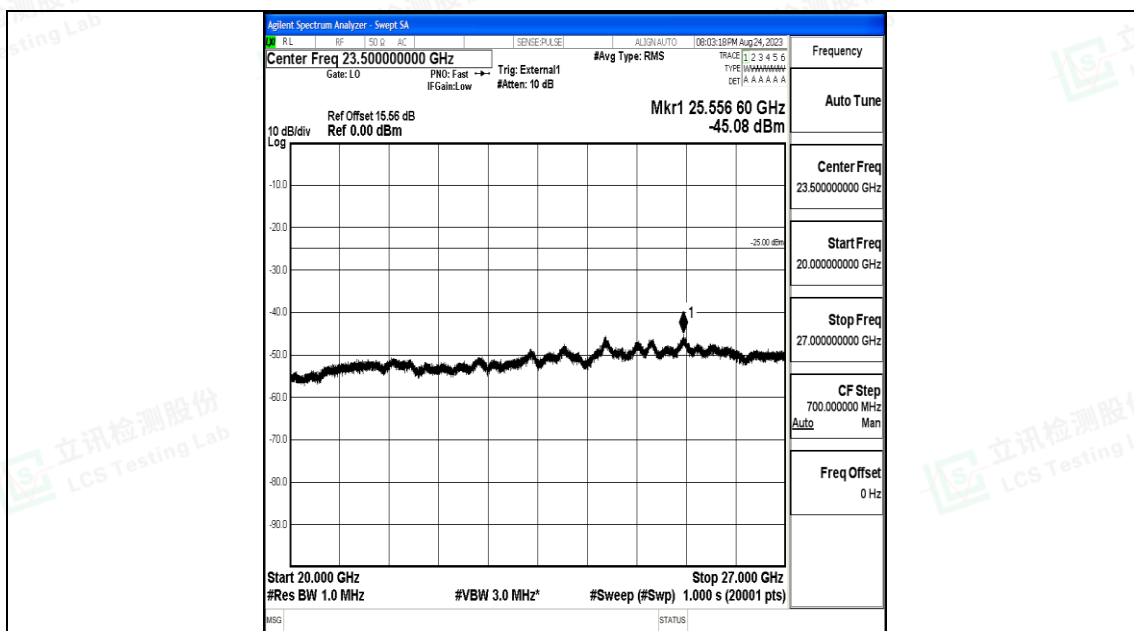



Band41_5MHz_QPSK_40620_1RB#0_20000~27000_20000~27000

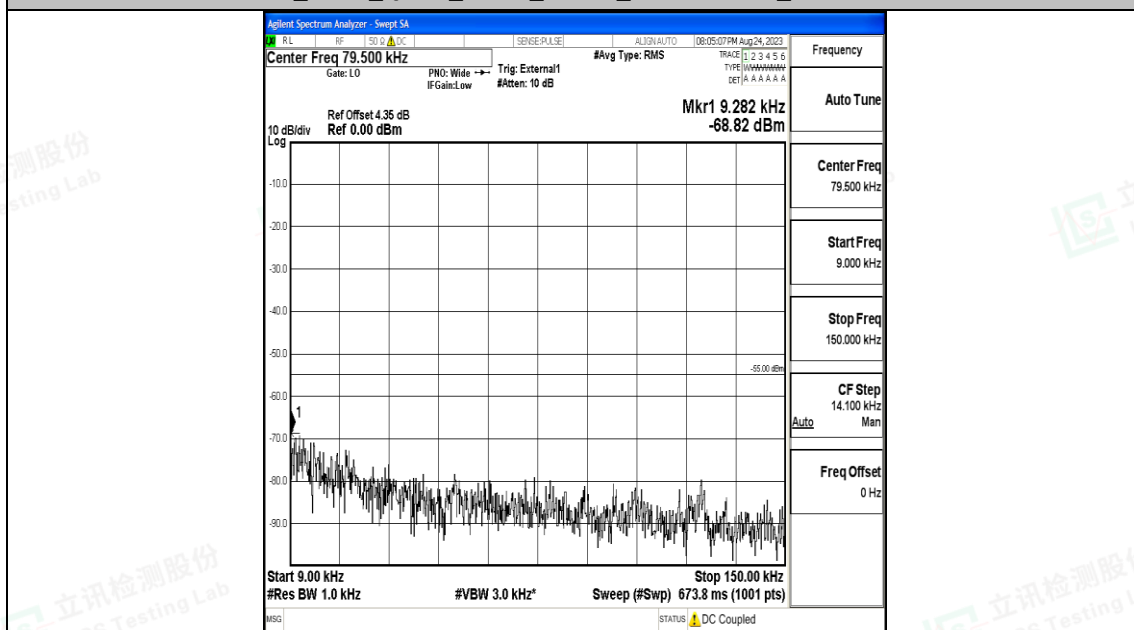


Band41_5MHz_QPSK_41565_1RB#0_0.009~0.15_0.009~0.15




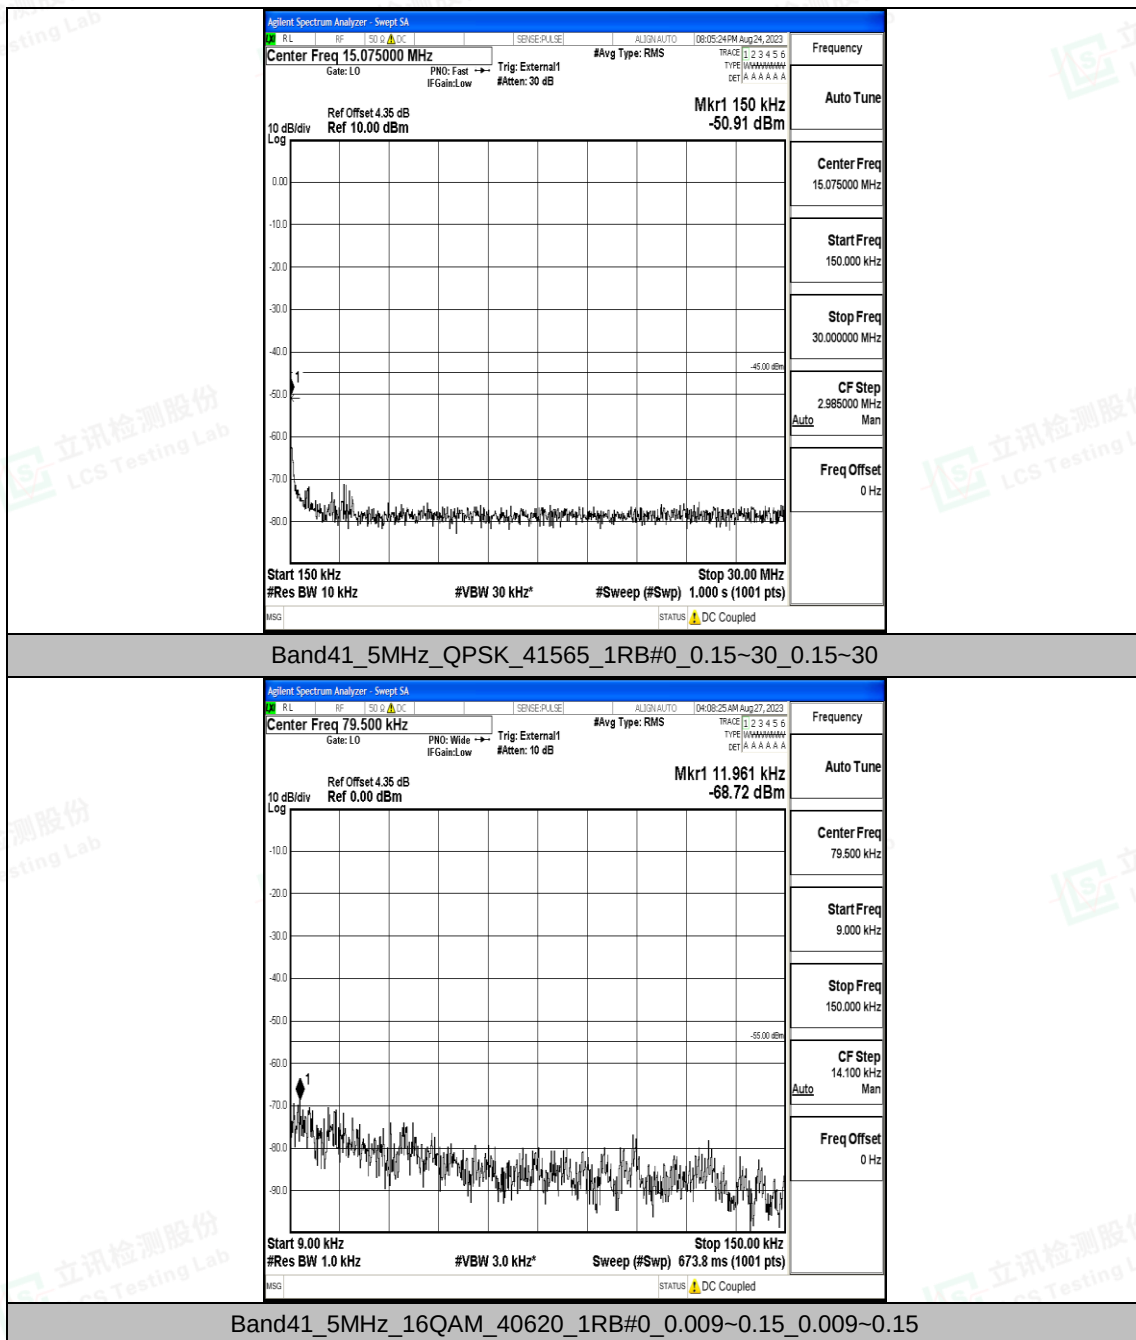

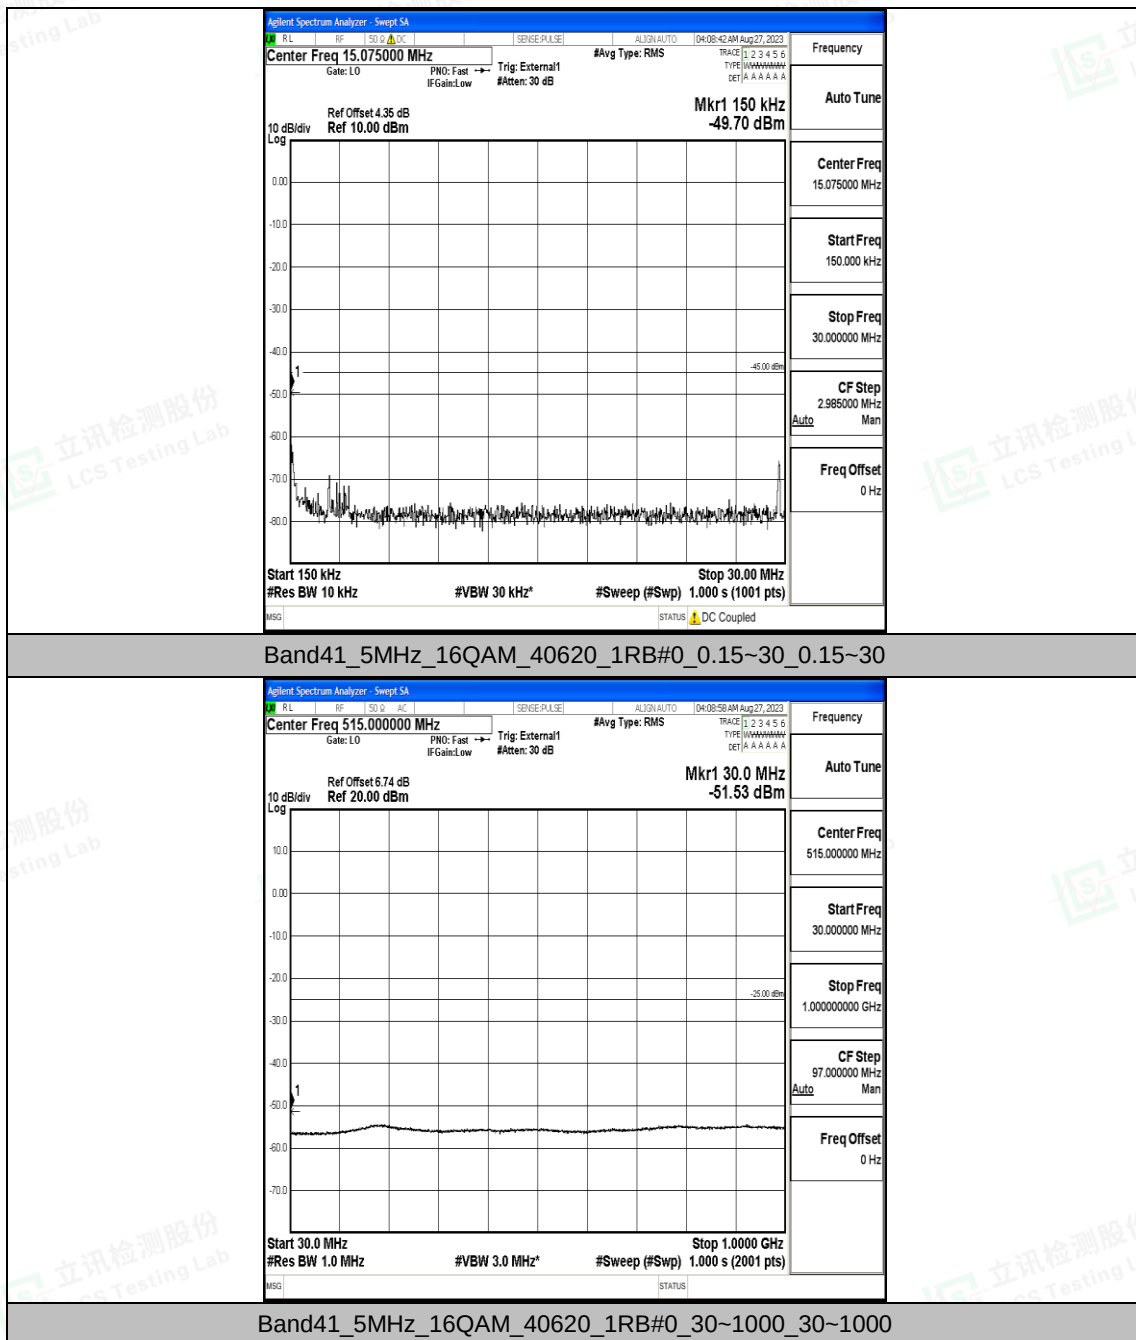

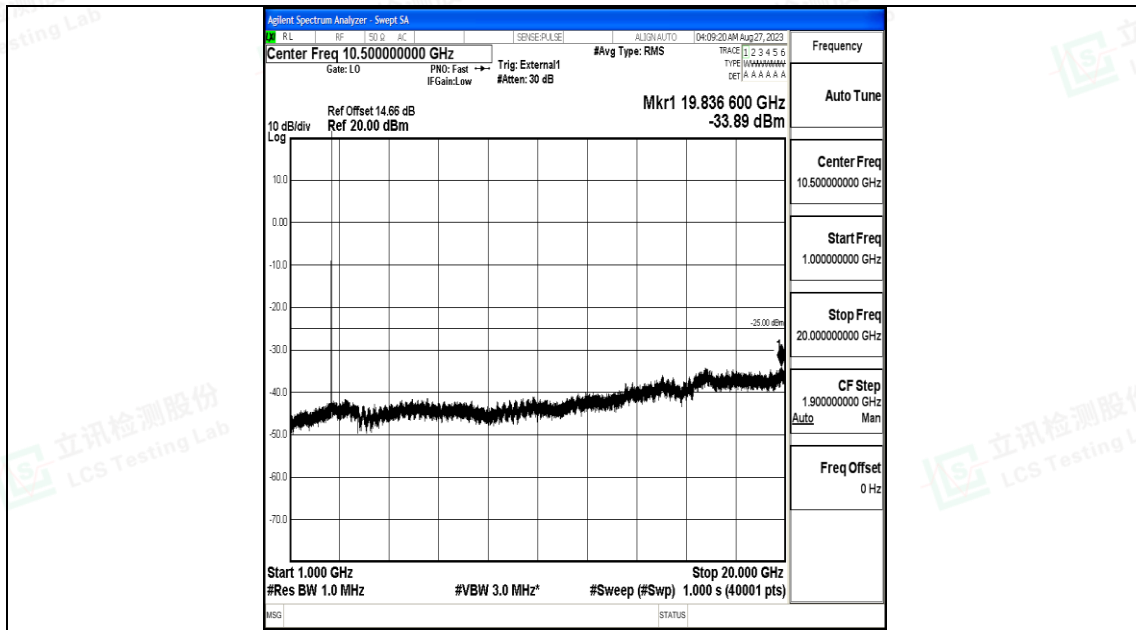

Band41_5MHz_16QAM_40620_1RB#0_1000~20000_1000~20000

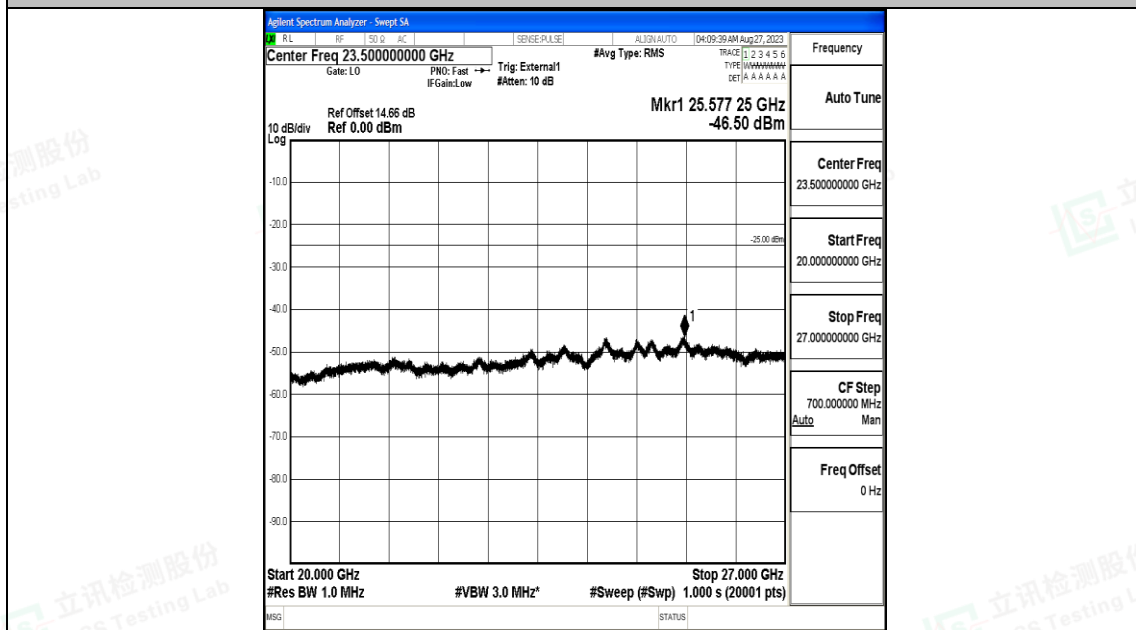

Band41_5MHz_16QAM_40620_1RB#0_20000~27000_20000~27000



