

BT1027B Antenna test report

Jiangxi Taide Wisdom Technology Co.,Ltd

<http://www.tddz.com>

Address:Room 101, No. 388 Bihu Road, Fenggang Town, Dongguan city,
Guangdong Province.

Revision History

Released Date	Version	Record	Tester
Nov.17th,2023	V1.0	Frist Turning	Hanquan Meng
Dec.11th,2023	V1.1	Optimize	Hanquan Meng
Jan.27th,2024	V1.2	DVT	Hanquan Meng
Feb.2th,2024	V1.3	Increase the shrapnel distance	Hanquan Meng
Feb.27th,2024	V1.3	Add PA	Hanquan Meng

Contents

Revised History	Page3
Requirement of Antenna Design and Measurement	Page4
Test Setup for Radiation Pattern Measurement	Page5
Antenna Placement & Solution.....	Page6
Antenna size	Page7
Microphone antenna matching circuit	Page8
VSWR Results/Smith chart	Page9
3D Radiation Pattern Results	Page10
2D Radiation Pattern Results	Page11
Results Summary (peak gain , efficiency)	Page12
TRP&TIS	Page13

Requirements of Antenna Design and Measuremen


Requirements of Antenna Design(From Customer Demand)

RF Function	Number of ANT	Frequency Band	Remark
ANT	1	Bluetooth	2402-2482MHz

Requirements of Measurement

Test Item	Specification (Free Space)	Remark
VSWR	VSWR<2.0	
Directional patten	/	
Antenna efficiency	efficiency>40%	PCB ANT
Antenna Isolation	/	
Over the air Performance	/	

Test Setup for Radiation Pattern Measurement

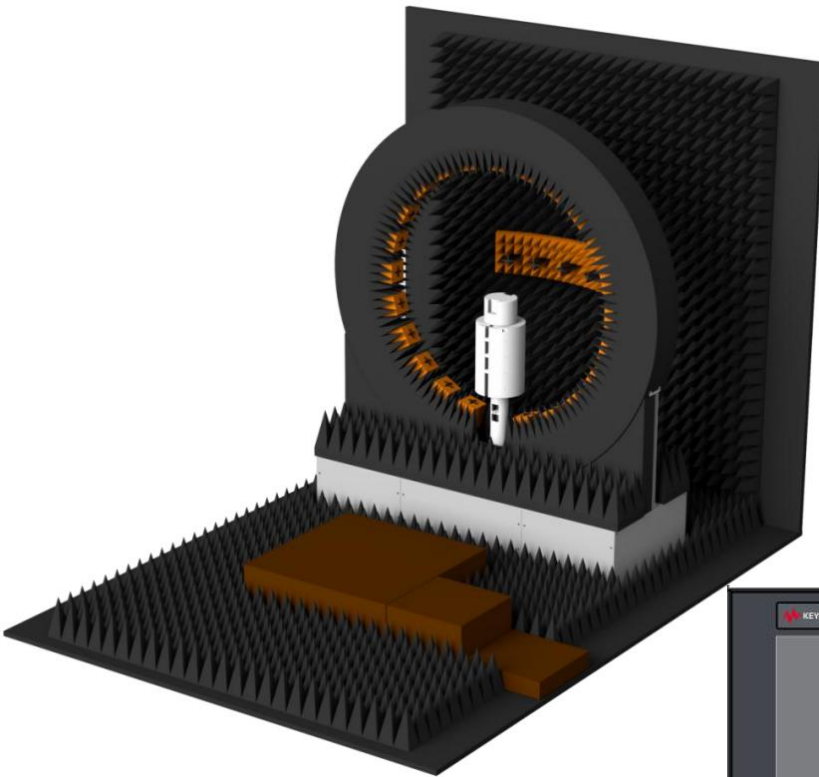


QUIPMENT	BRAND	MODULE TYPE
Network Analyzer	KEYSIGHT	E5071C 9k~8.5G
Signal Generator	R&S	CMW 500
Microwave anechoic chamber	XH-IOE	ATS-300




Antenna Placement & Solution (天线位置&接地处理)



Product picture

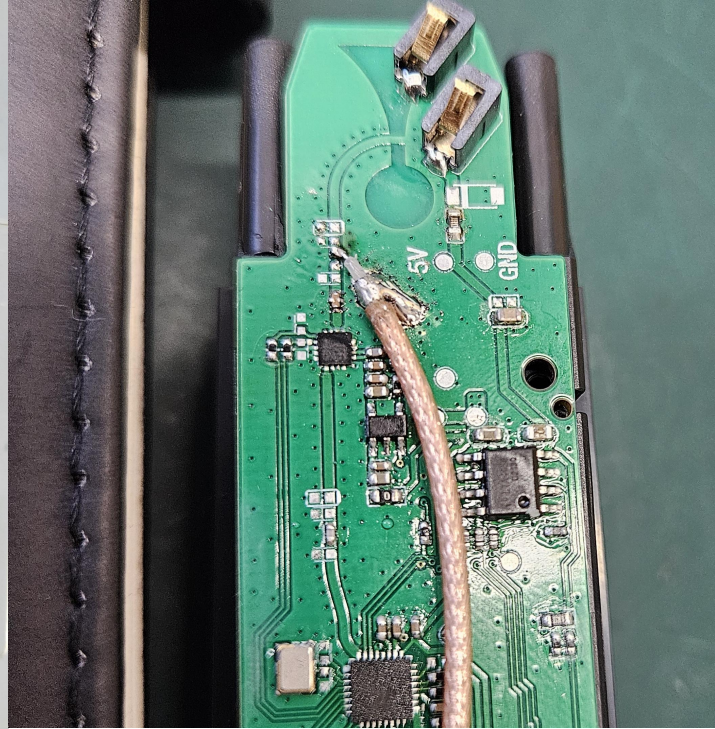


Product internal picture

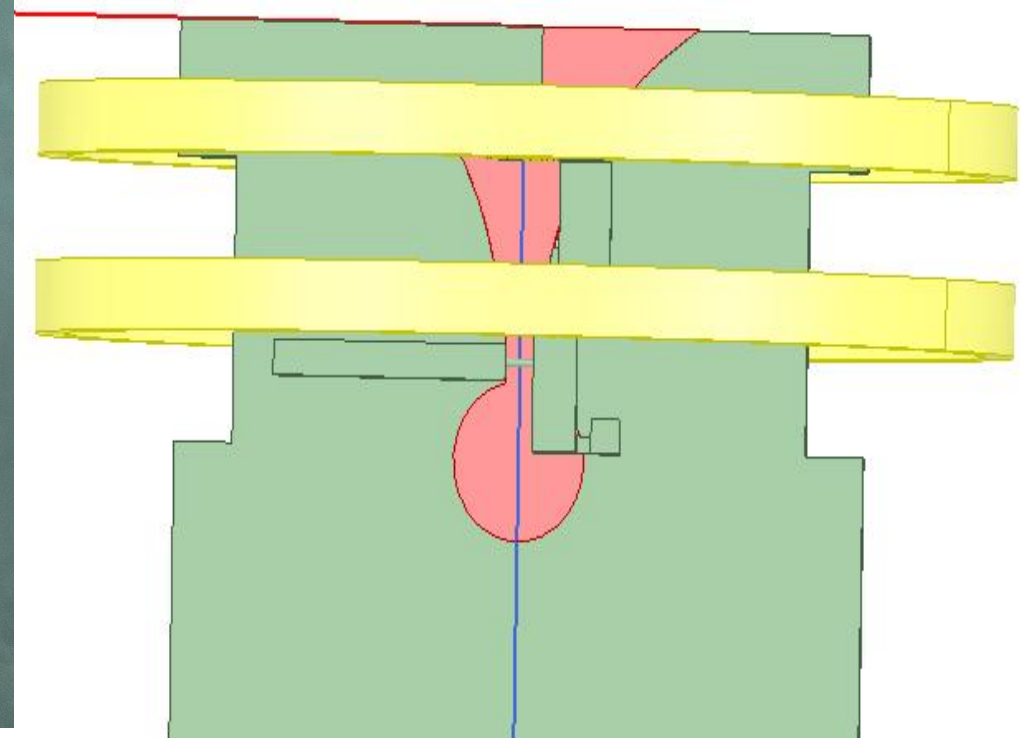


Antenna close-up

Antenna size (Outline drawing)

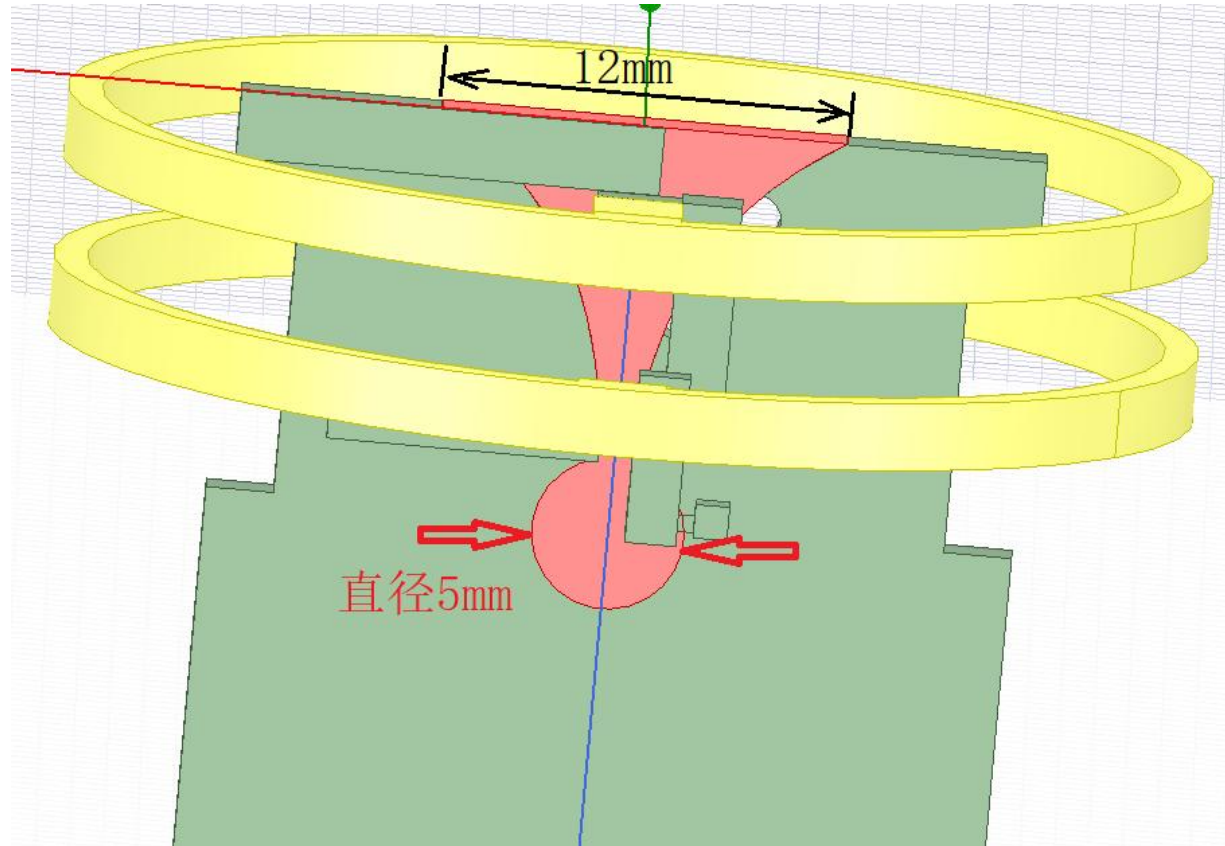

Microphone antenna matching circuit

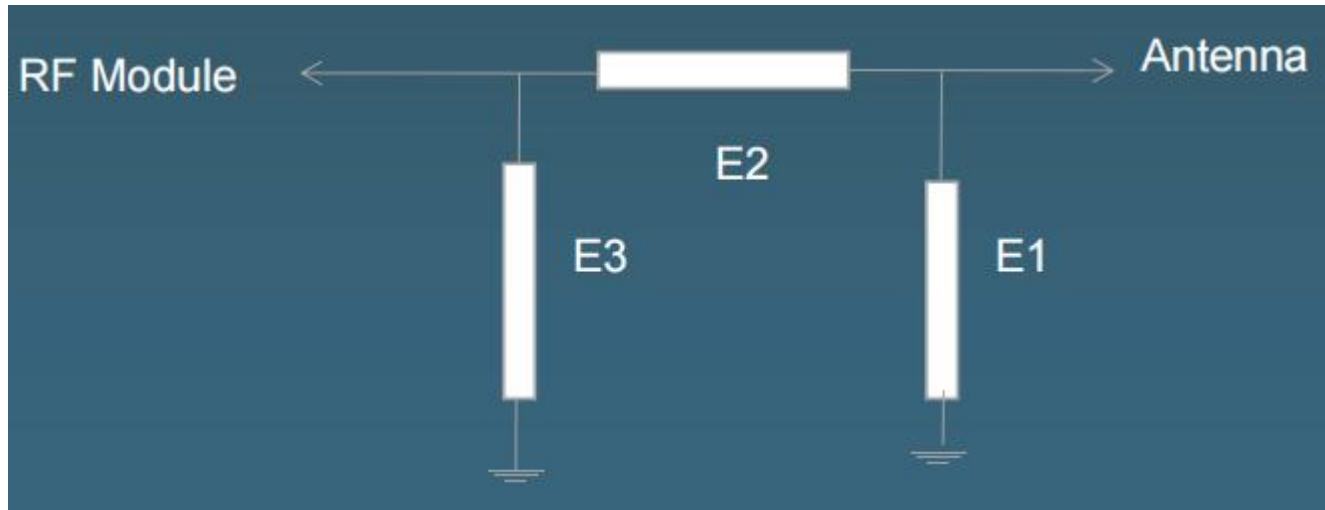

Any changes:


No change

Modified




✓

Element	Value
E1(0402)	NC
E2(0402)	10pF
E3(0402)	NC



VSWR Results/Smith chart

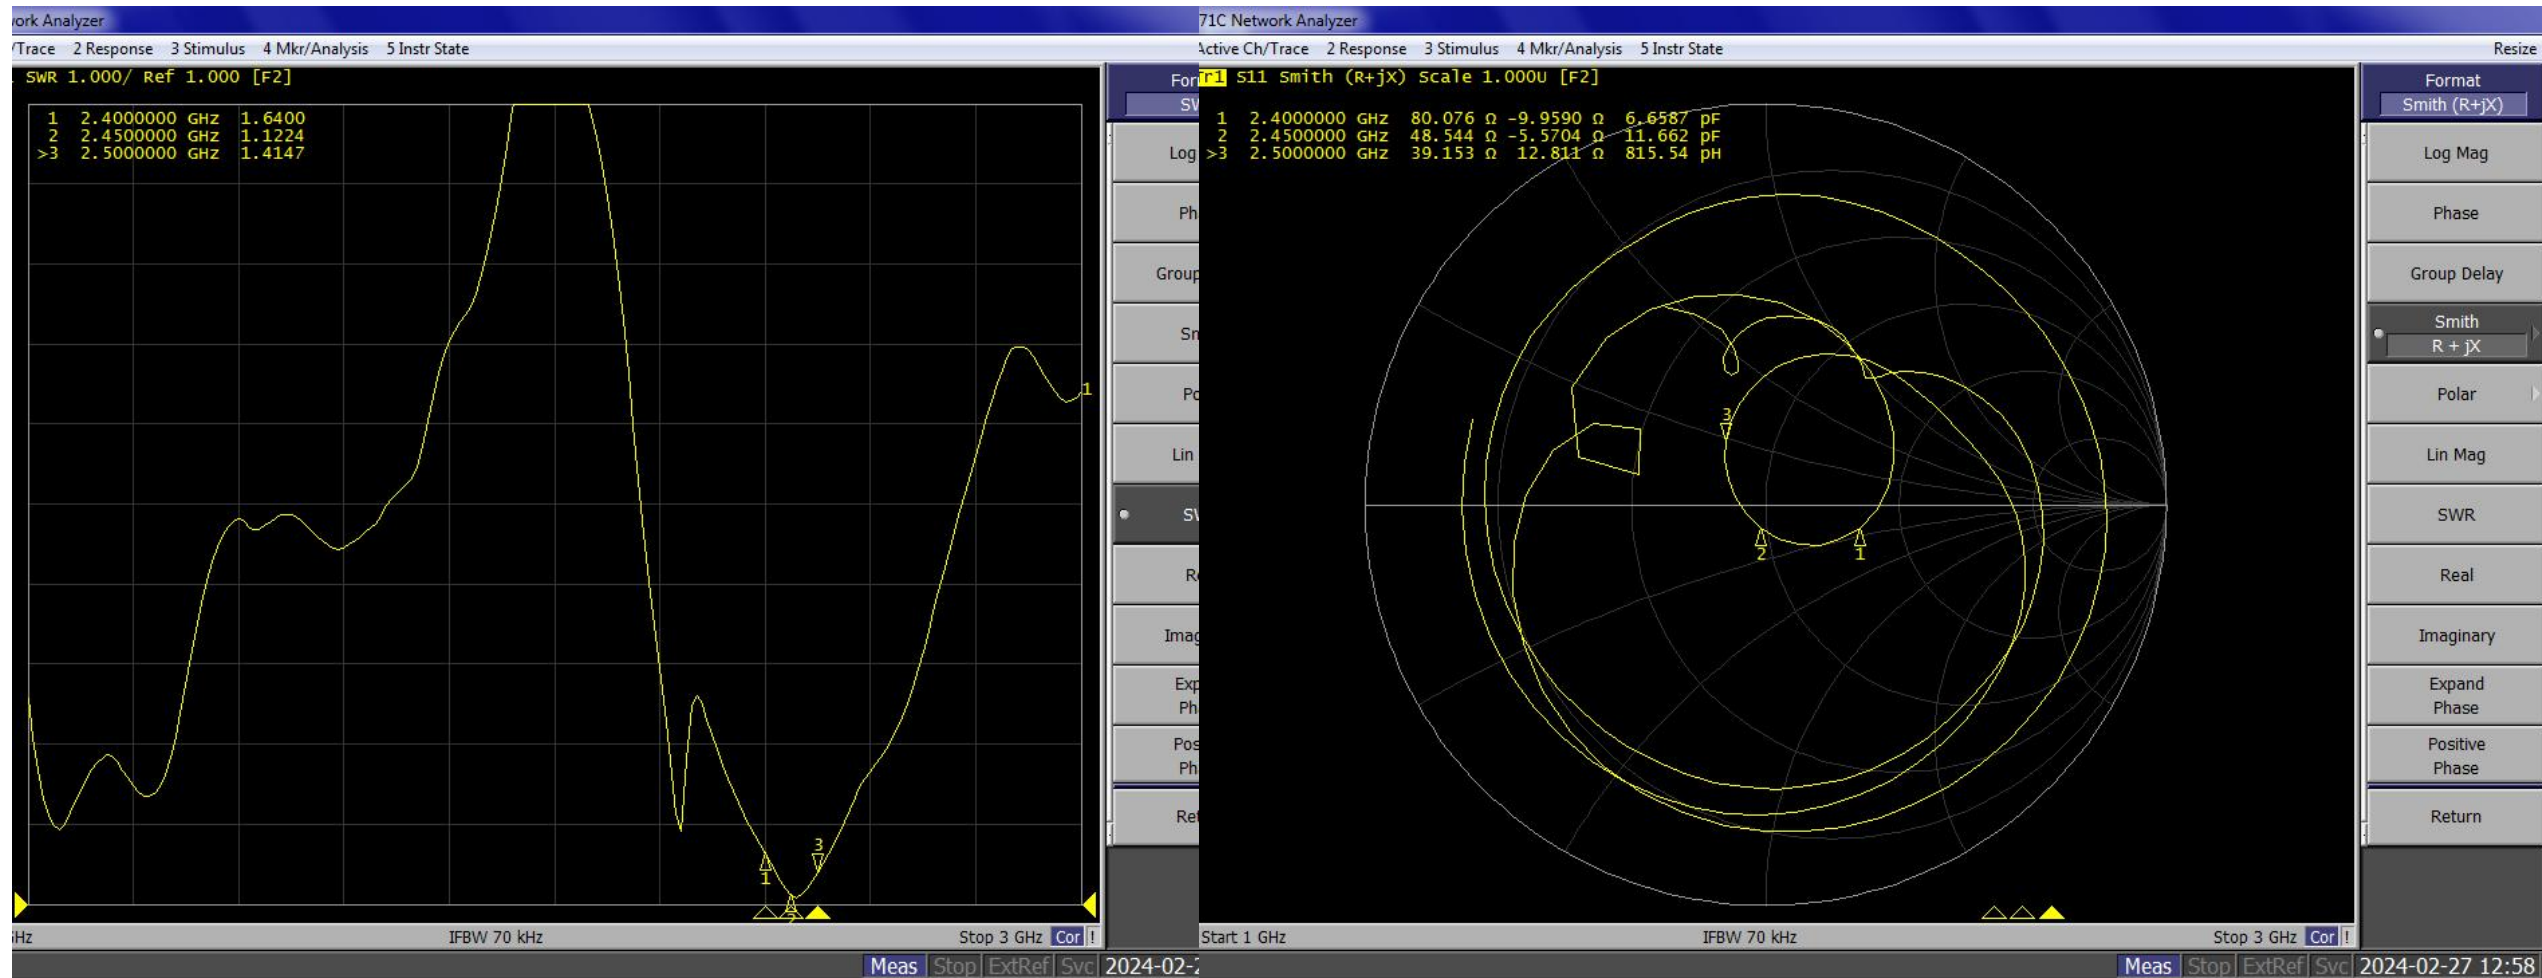

3D Radiation Pattern Results

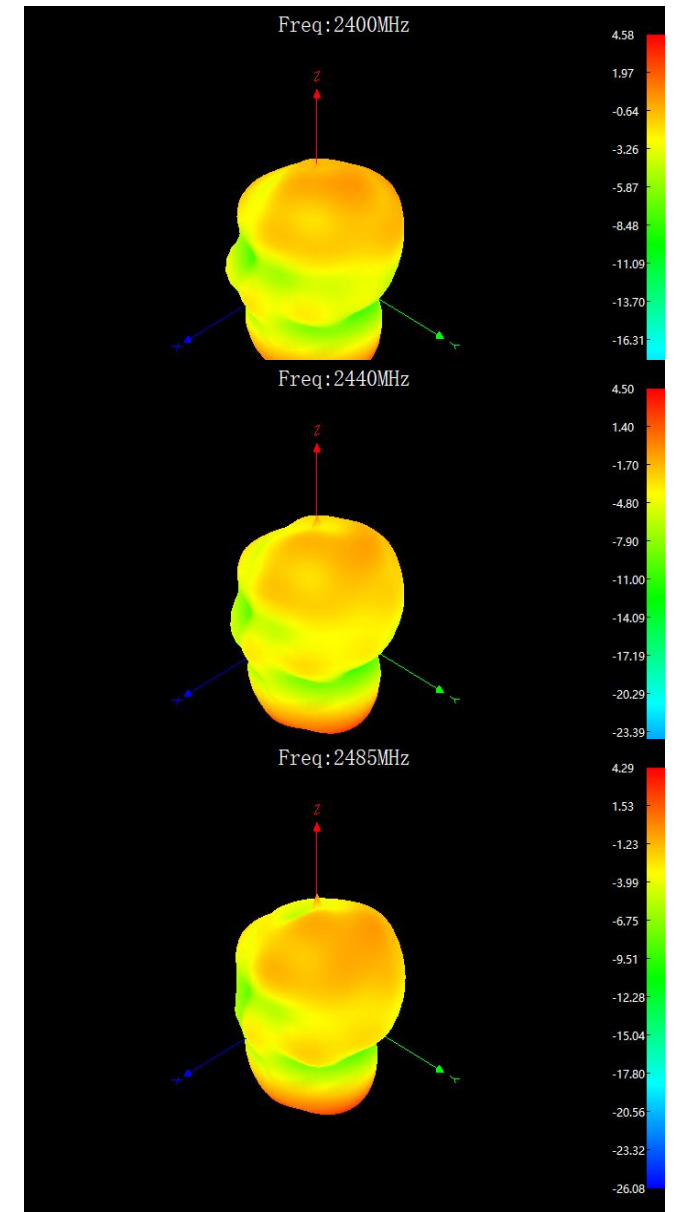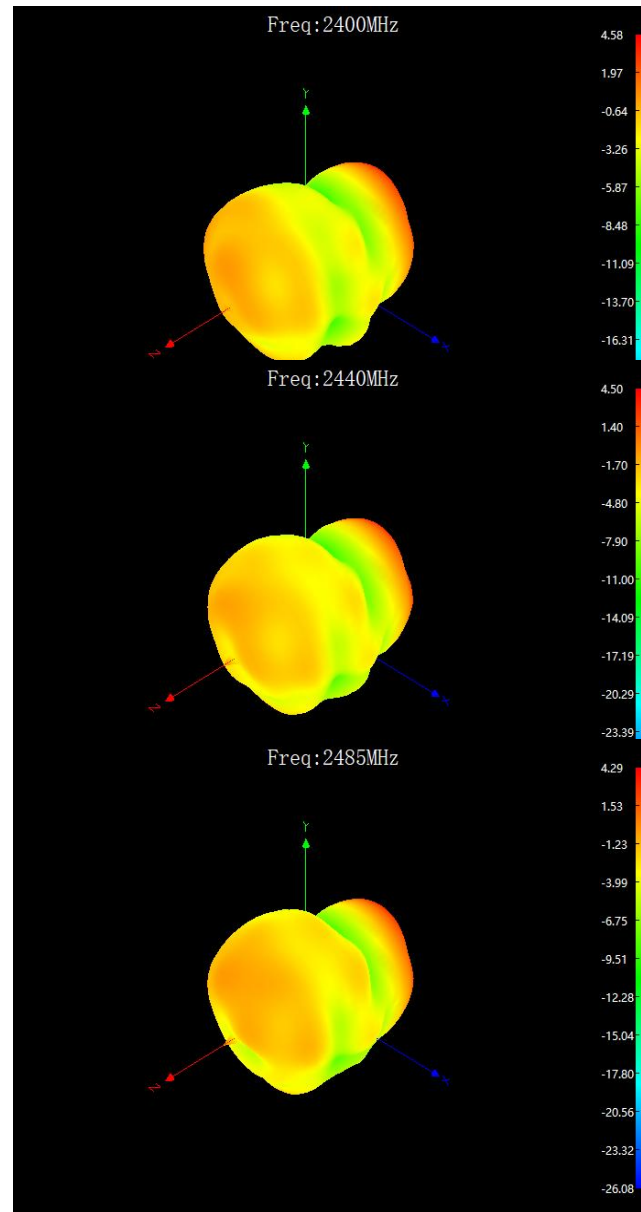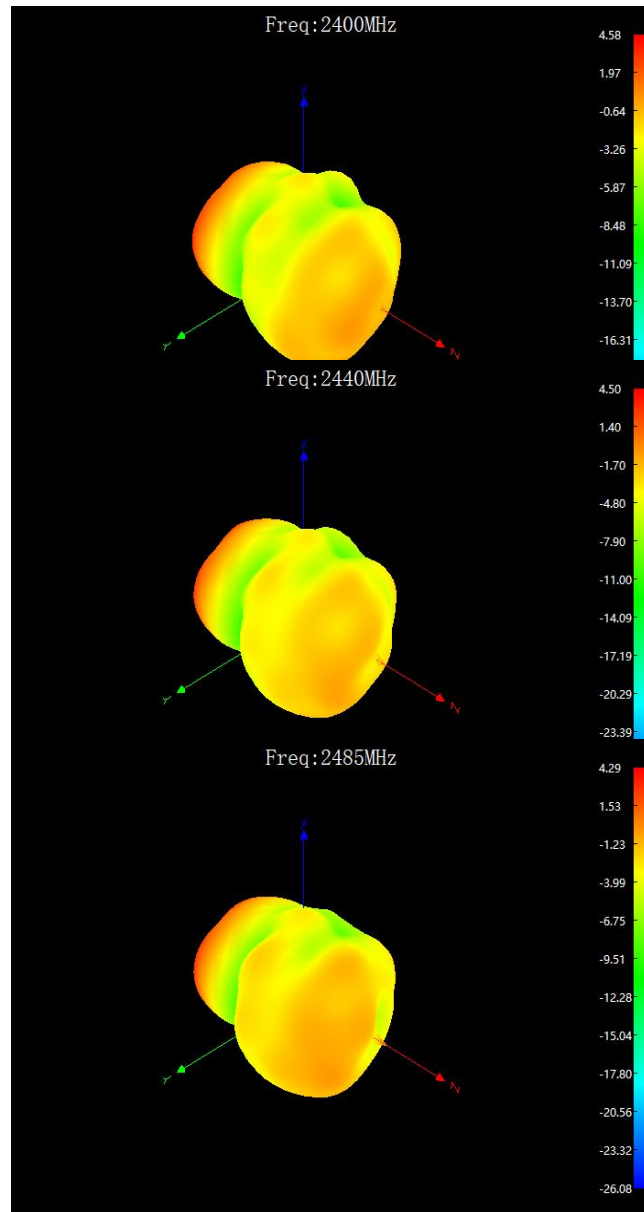

2D Radiation Pattern Results

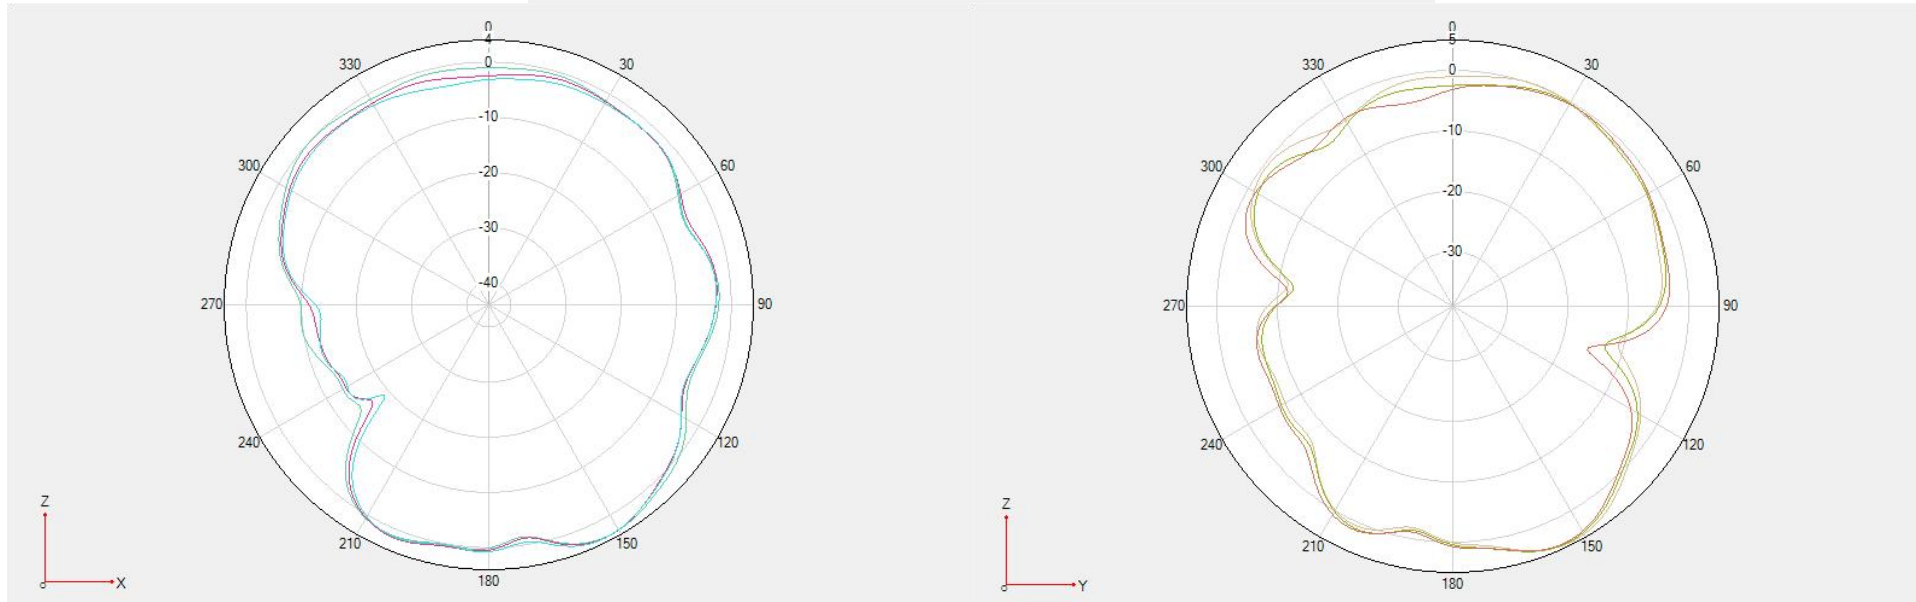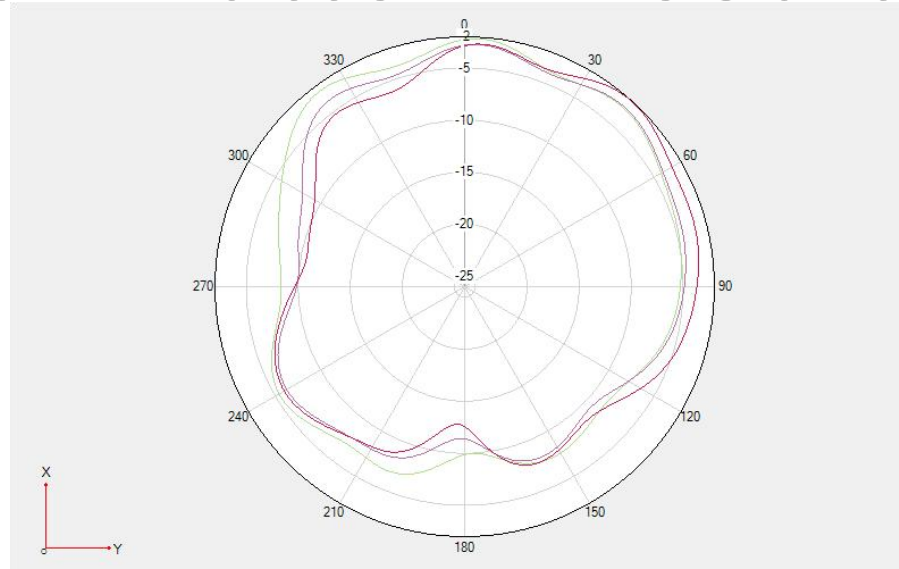

Results Summary-Peak Gain &Efficiency

Frequency/Mhz	Efficiency / dB	Efficiency / %	MaxGain/dBi	AvgGain/dBi
2400	-2.37	57.94	4.58	-2.37
2405	-2.11	61.52	4.81	-2.11
2410	-2.19	60.39	4.62	-2.19
2415	-2.25	59.57	4.46	-2.25
2420	-1.87	65.01	4.86	-1.87
2425	-1.81	65.92	4.87	-1.81
2430	-1.91	64.42	4.75	-1.91
2435	-1.96	63.68	4.65	-1.96
2440	-2.05	62.37	4.5	-2.05
2445	-1.85	65.31	4.78	-1.85
2450	-1.85	65.31	4.79	-1.85
2455	-1.91	64.42	4.61	-1.91
2460	-1.87	65.01	4.66	-1.87
2465	-1.99	63.24	4.57	-1.99
2470	-2.02	62.81	4.54	-2.02
2475	-2.14	61.09	4.29	-2.14
2480	-2.26	59.43	4.01	-2.26
2485	-2.03	62.66	4.29	-2.03

TRP&TIS (OTA Test Data) :

DUT NO.	Channel	Frequency	Test data(dBm)	
			TRP	TIS
1#	0	2402	NA	NA
	39	2441	NA	NA
	78	2480	NA	NA

Conclusion (结论)

- 该项目为板载天线+充电铜环组成的复合天线，平均效率62.7%，性能可满足需求。

重要说明 NOTICE



1

请贵司注意报告中的匹配是否更改、环境处理是否可行；这直接影响天线性能，若有异议请及时与本司联系；

Please pay attention to whether the matching in the report has changed and whether the environmental treatment is feasible; This will directly affect the antenna performance, if you have any objections, please contact us in time;

2

若贵司机器有更换物料、更新软件、环处理变更等，须及时提供最新状态机器来我司验证；

If your driver has replacement materials, updated software, environmental processing changes, etc., you must provide the latest status machine to our company for verification in time

3

若贵公司机器需送第三方验证或送检，请最好提供送测机器来我司测试验证OK后方可送测（因为主板、环境处理、天线组装等一致性会影响天线性偏差）

If your company's machine needs to be sent to a third party for verification or inspection, it is best to provide the test machine to our company to test and verify OK before sending it for testing (because the consistency of the motherboard, environmental treatment, antenna assembly and so on will affect the antenna deviation)