Appendix Test Data

Report No.:	1812C50447912501	Test Sample No.:	1-2-2
Start Test Date:	2025-8-29	Finish Test Date:	2025-9-4
Test Engineer:	dylan. Ma	Auditor:	Justin Feng
Temperature:	25.7℃	Relative Humidity:	44%
Pressure:	101kPa		

Appendix A: 20dB Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	20db EBW[MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	1.04	2401.50	2402.54	---	---
DH5	Ant1	2441	1.05	2440.49	2441.54	---	---
DH5	Ant1	2480	1.07	2479.48	2480.54	---	---
2DH5	Ant1	2402	1.32	2401.36	2402.68	---	---
2DH5	Ant1	2441	1.33	2440.36	2441.69	---	---
2DH5	Ant1	2480	1.34	2479.36	2480.70	---	---
3DH5	Ant1	2402	1.29	2401.38	2402.67	---	---
3DH5	Ant1	2441	1.29	2440.38	2441.67	---	---
3DH5	Ant1	2480	1.31	2479.37	2480.68	---	---

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs

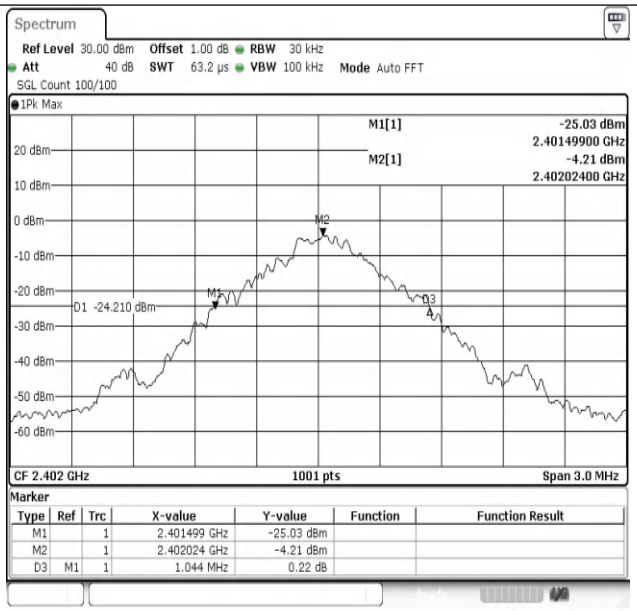

DH5-Ant1-2402

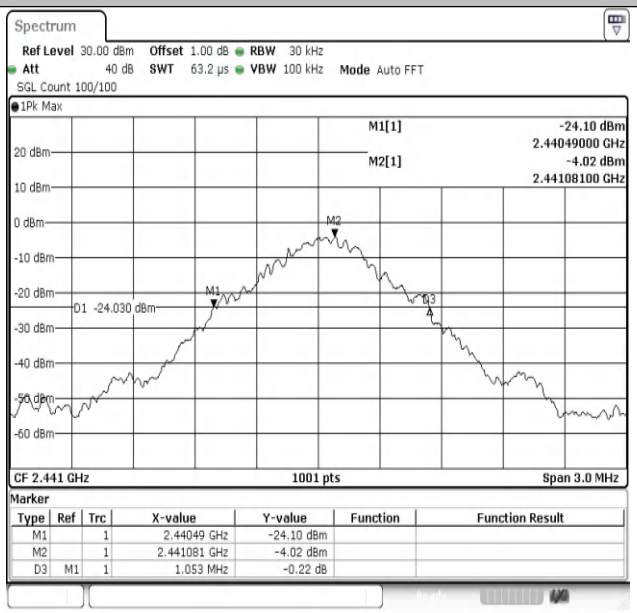

DH5-Ant1-2441

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

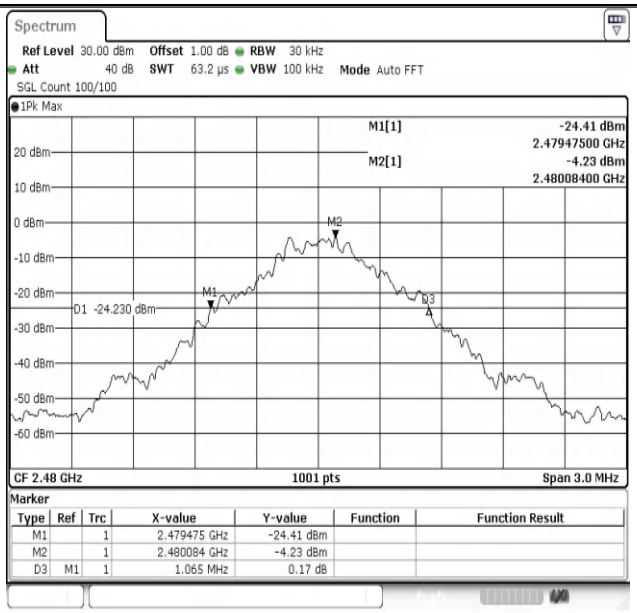

DH5-Ant1-2480

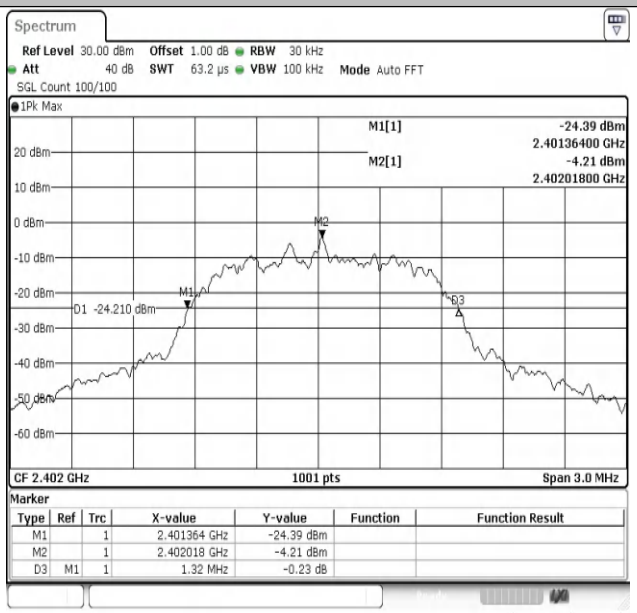

2DH5-Ant1-2402

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

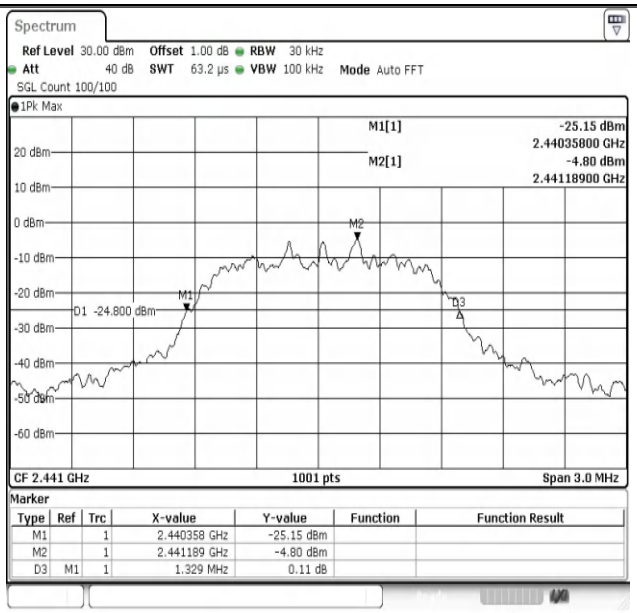

2DH5-Ant1-2441

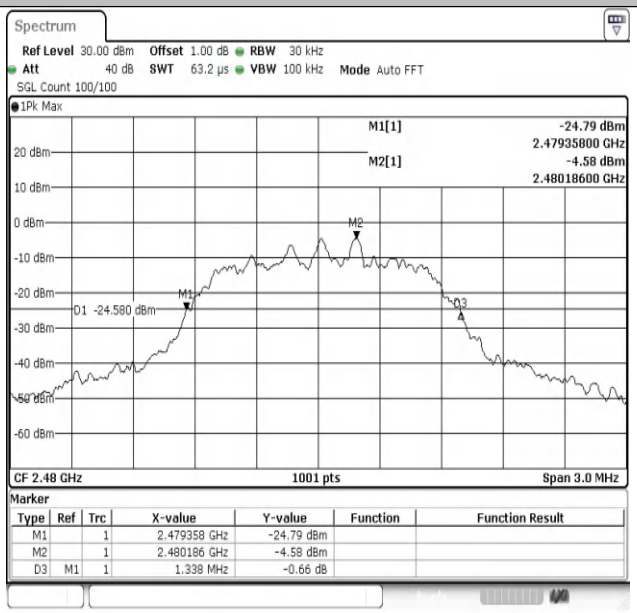

2DH5-Ant1-2480

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

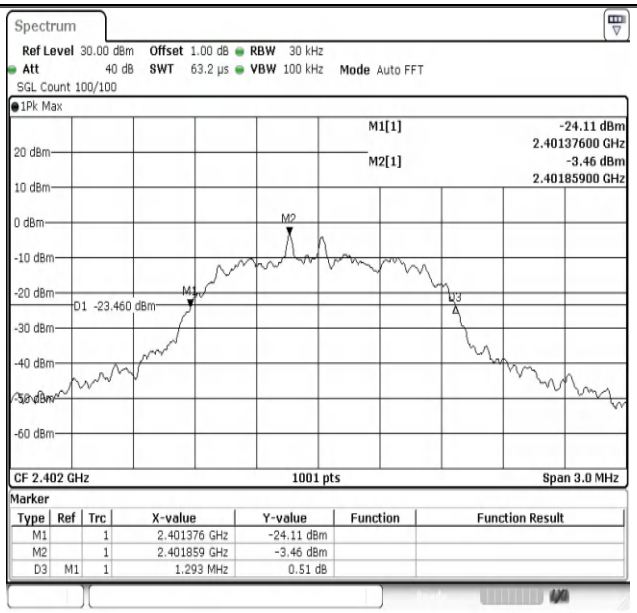

3DH5-Ant1-2402

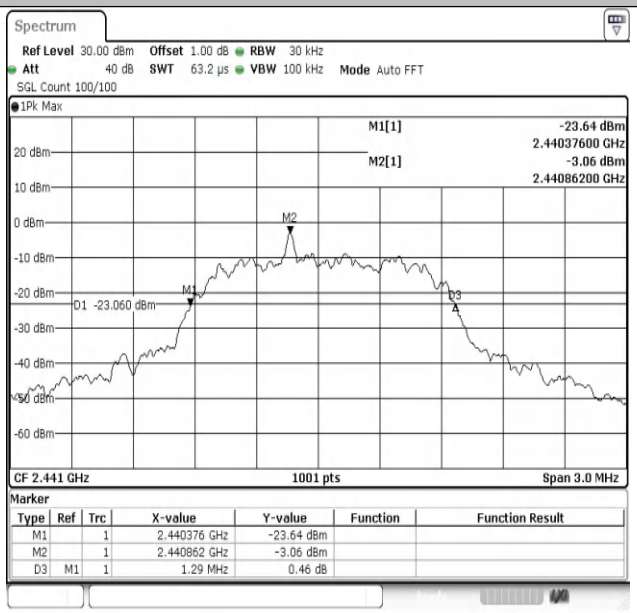

3DH5-Ant1-2441

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

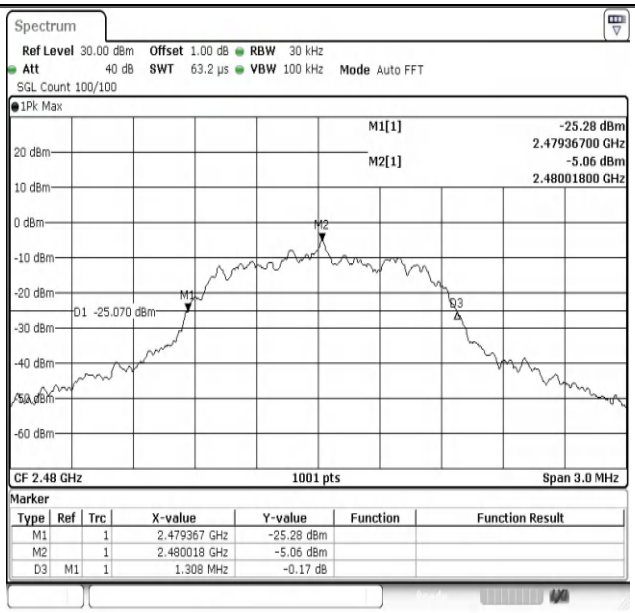

3DH5-Ant1-2480

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Appendix B: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	0.92907	2401.5504	2402.4795	---	---
DH5	Ant1	2441	0.94406	2440.5415	2441.4855	---	---
DH5	Ant1	2480	0.95604	2479.5415	2480.4975	---	---
2DH5	Ant1	2402	1.2018	2401.4306	2402.6324	---	---
2DH5	Ant1	2441	1.2228	2440.4246	2441.6474	---	---
2DH5	Ant1	2480	1.2318	2479.4216	2480.6533	---	---
3DH5	Ant1	2402	1.2138	2401.4126	2402.6264	---	---
3DH5	Ant1	2441	1.2168	2440.4126	2441.6294	---	---
3DH5	Ant1	2480	1.2258	2479.4036	2480.6294	---	---

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs

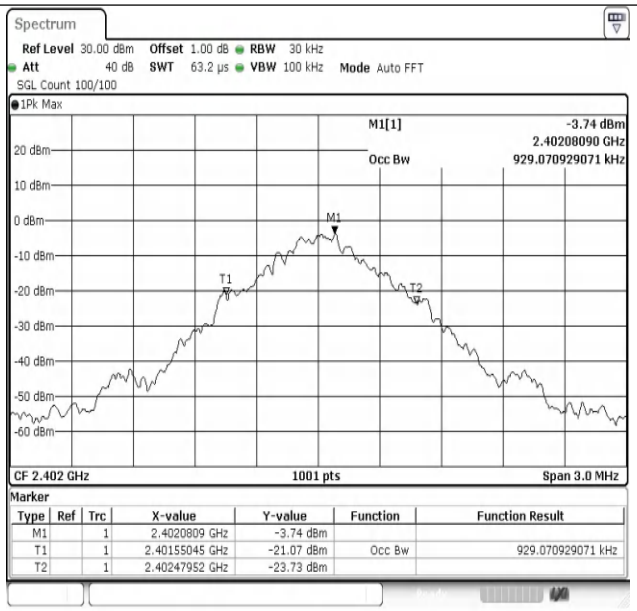

DH5-Ant1-2402

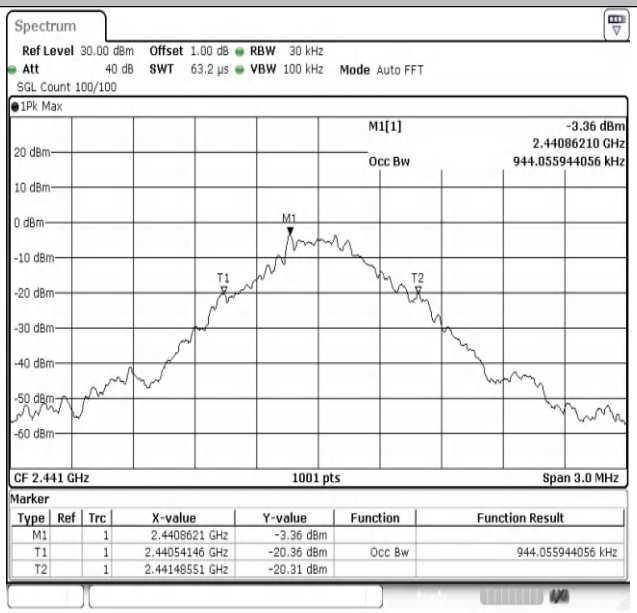

DH5-Ant1-2441

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

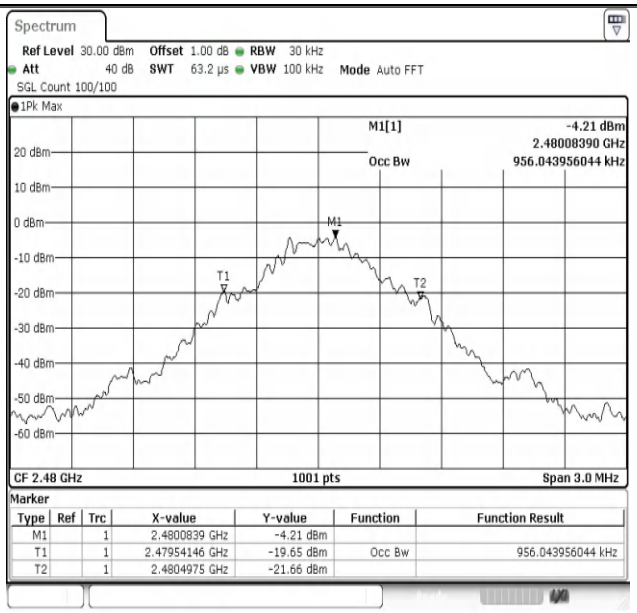

DH5-Ant1-2480

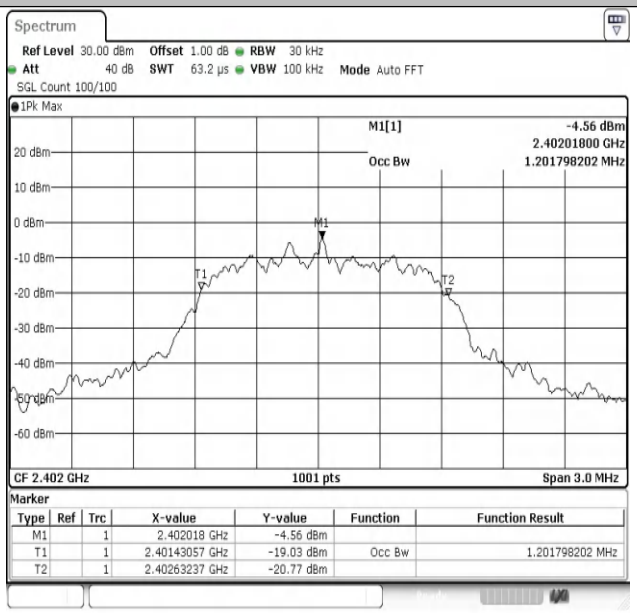

2DH5-Ant1-2402

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

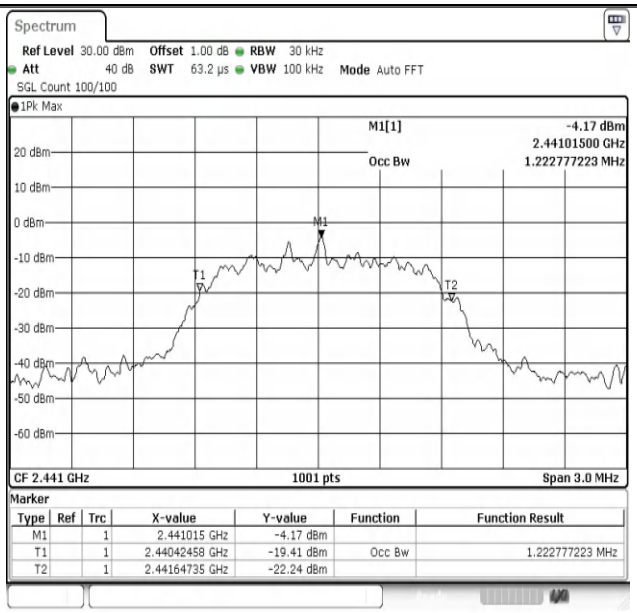

2DH5-Ant1-2441

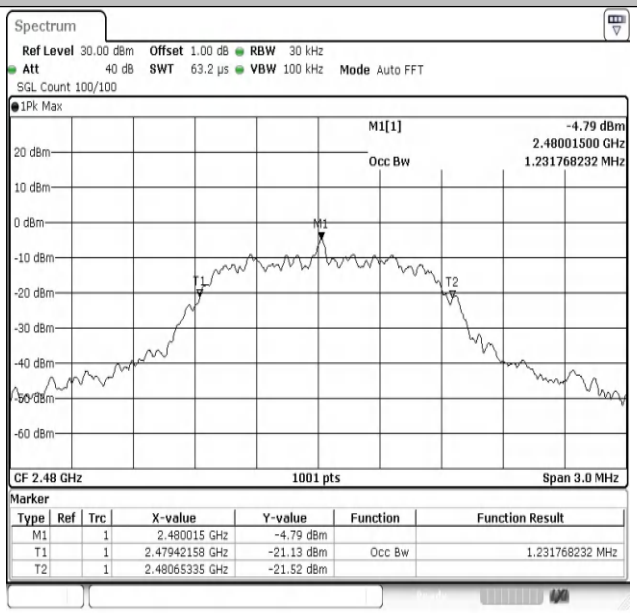

2DH5-Ant1-2480

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

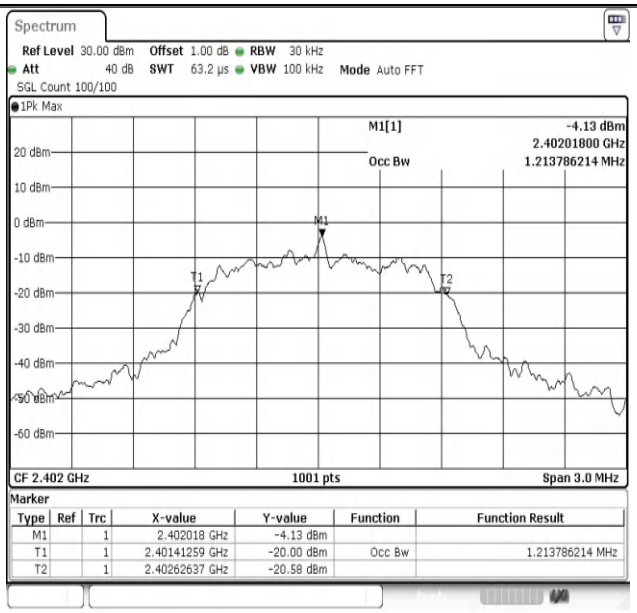

3DH5-Ant1-2402

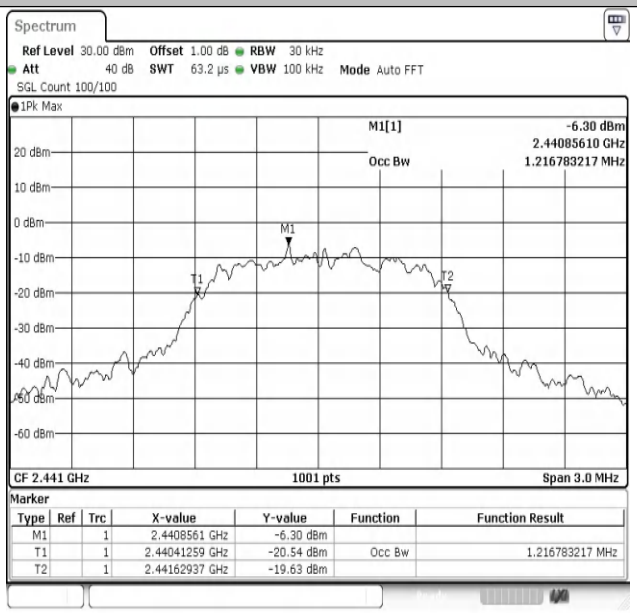

3DH5-Ant1-2441

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

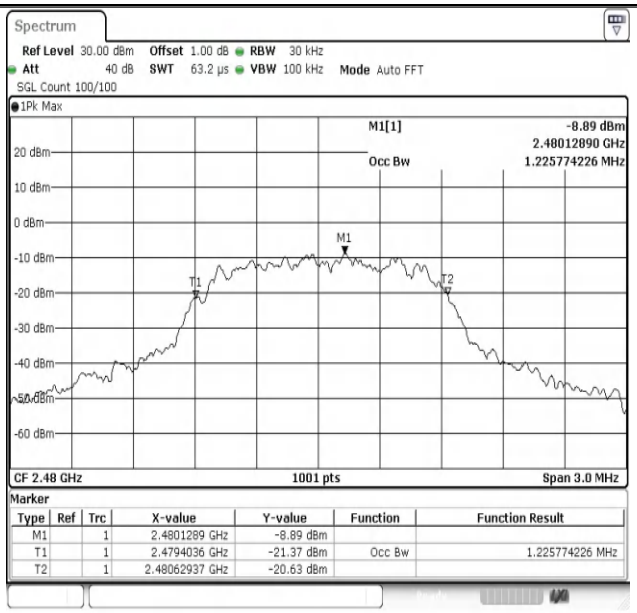

3DH5-Ant1-2480

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Appendix C: Maximum Conducted Output Power

Test Result Peak

Test Mode	Antenna	Frequency[MHz]	Conducted Peak Power[dBm]	Conducted Limit[dBm]	Verdict
DH5	Ant1	2402	-0.84	≤20.97	PASS
DH5	Ant1	2441	-0.79	≤20.97	PASS
DH5	Ant1	2480	-1.01	≤20.97	PASS
2DH5	Ant1	2402	-0.26	≤20.97	PASS
2DH5	Ant1	2441	-0.12	≤20.97	PASS
2DH5	Ant1	2480	-0.48	≤20.97	PASS
3DH5	Ant1	2402	**0.35**	≤20.97	PASS
3DH5	Ant1	2441	-0.13	≤20.97	PASS
3DH5	Ant1	2480	-0.61	≤20.97	PASS

Test Graphs

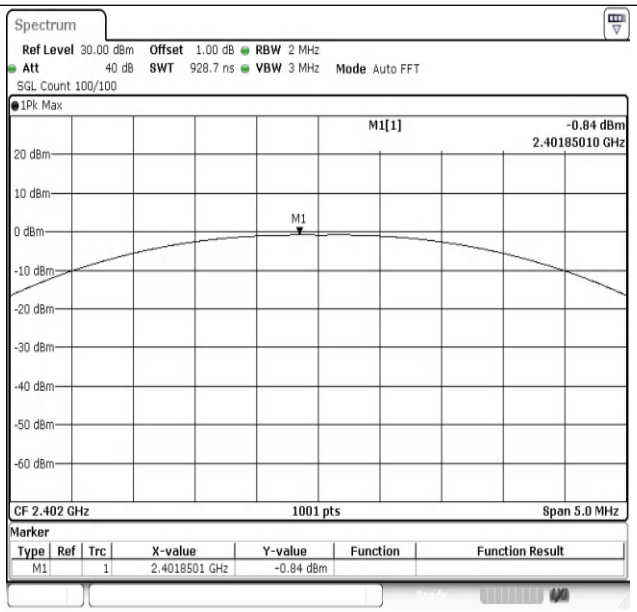

DH5-Ant1-2402-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

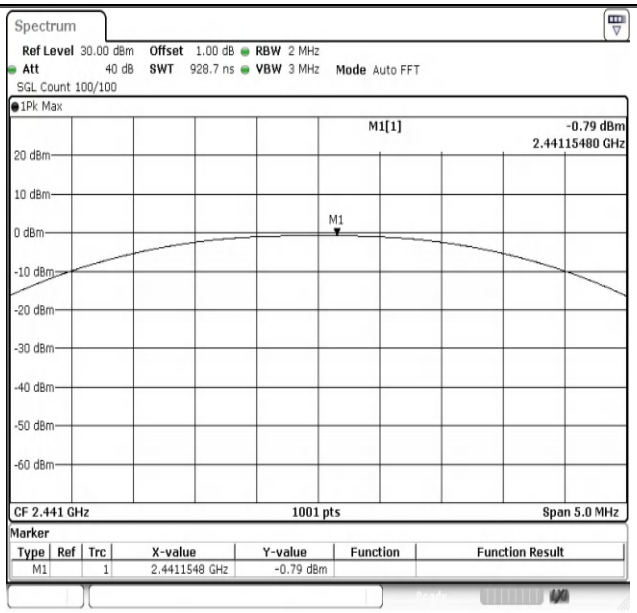

DH5-Ant1-2441-PASS

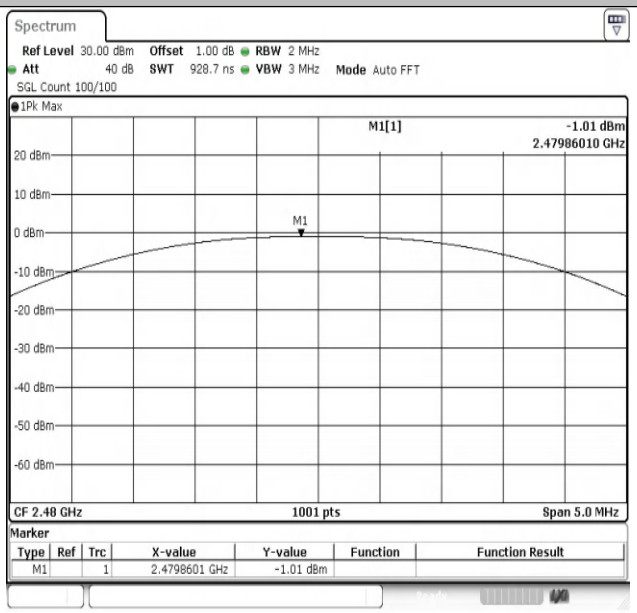

DH5-Ant1-2480-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

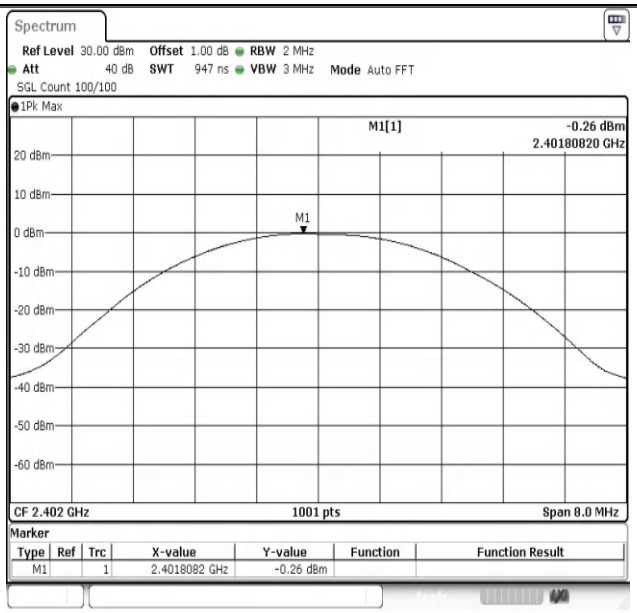

2DH5-Ant1-2402-PASS

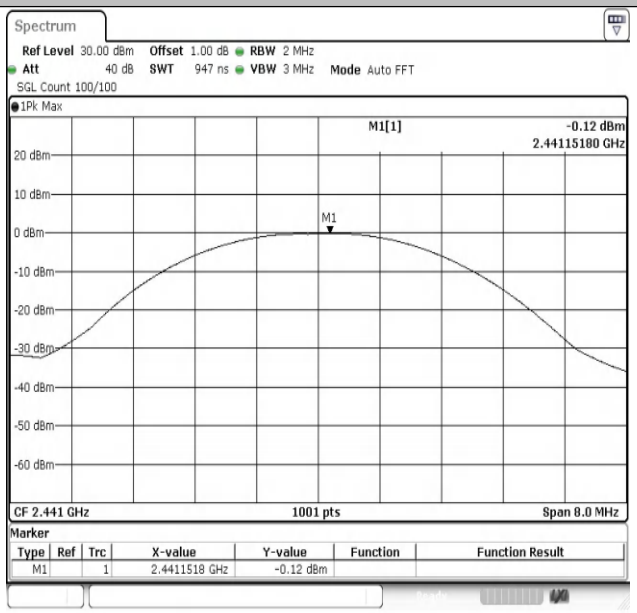

2DH5-Ant1-2441-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

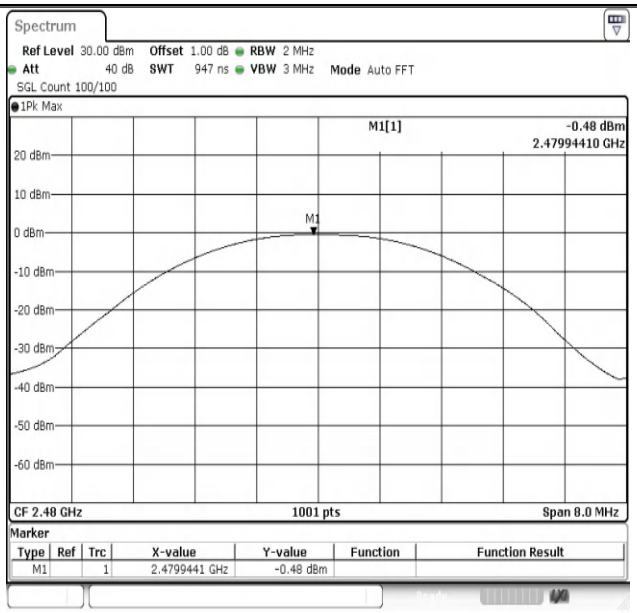

2DH5-Ant1-2480-PASS

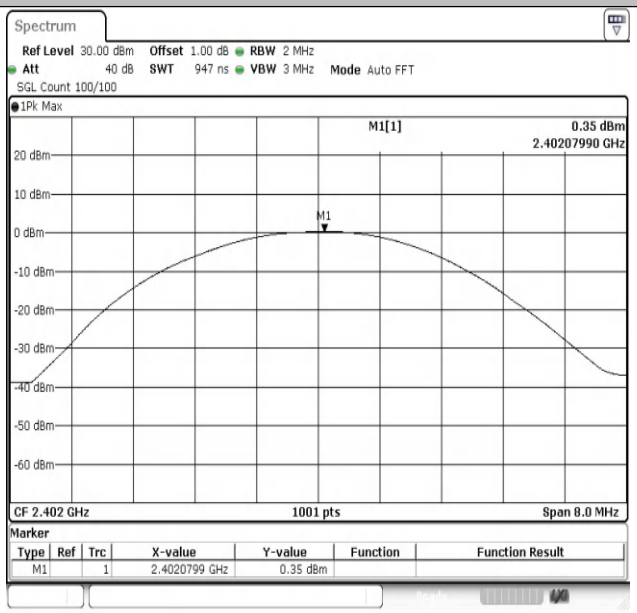

3DH5-Ant1-2402-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

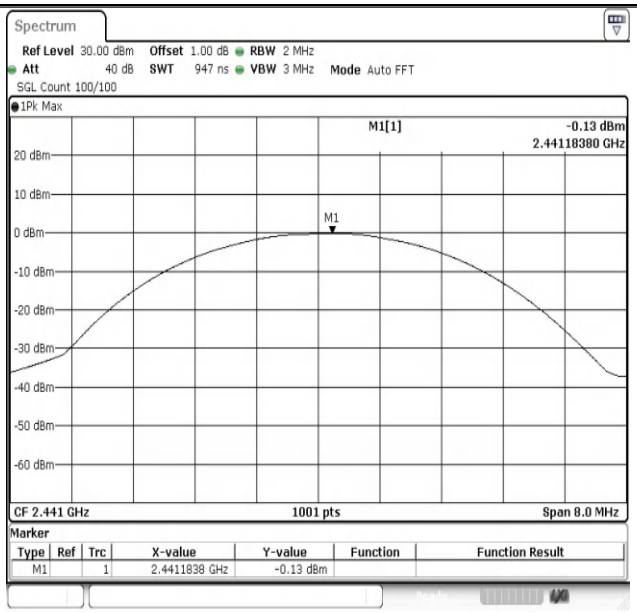

3DH5-Ant1-2441-PASS

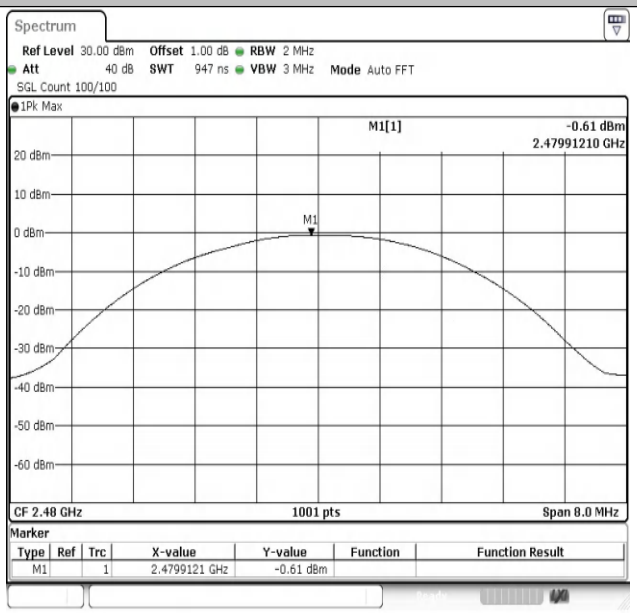

3DH5-Ant1-2480-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Carrier frequency separation

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [MHz]	Limit[MHz]	Verdict
DH5	Ant1	Hop	0.994	≥0.713	PASS
2DH5	Ant1	Hop	1.000	≥0.893	PASS
3DH5	Ant1	Hop	1.000	≥0.873	PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Test Graphs

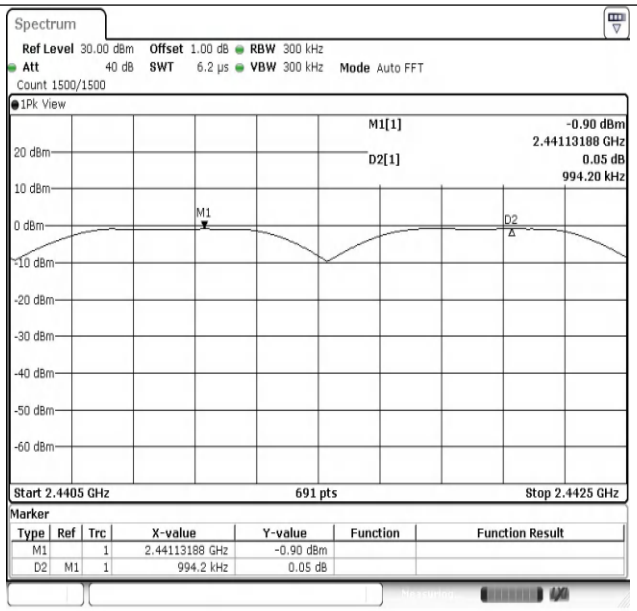

DH5-Ant1-Hop-PASS

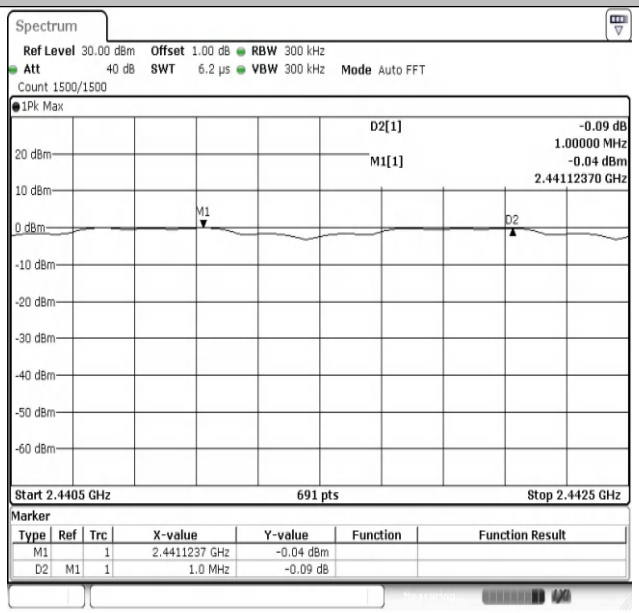

2DH5-Ant1-Hop-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

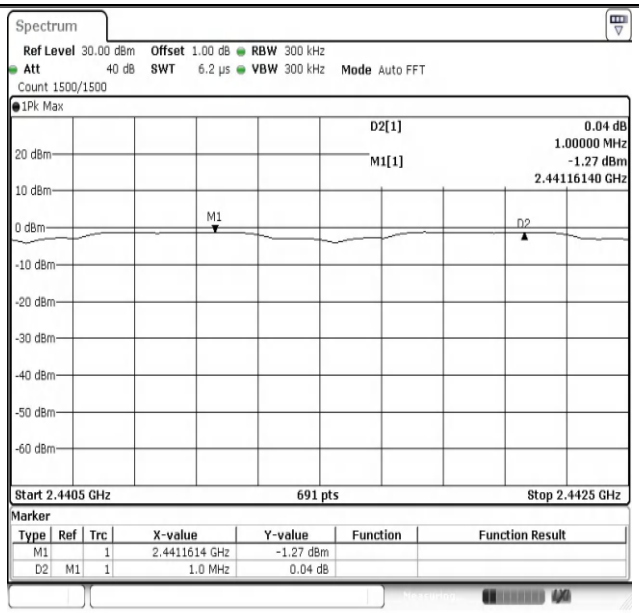

3DH5-Ant1-Hop-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Appendix E: Dwell Time

Test Result

Test Mode	Antenna	Frequency [MHz]	Burst Width [ms]	Total Hops [Num]	Result [s]	Limit [s]	Verdict
DH5	Ant1	Hop	2.879	100	0.288	≤0.4	PASS
2DH5	Ant1	Hop	2.885	106	0.306	≤0.4	PASS
3DH5	Ant1	Hop	2.888	99	0.286	≤0.4	PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs

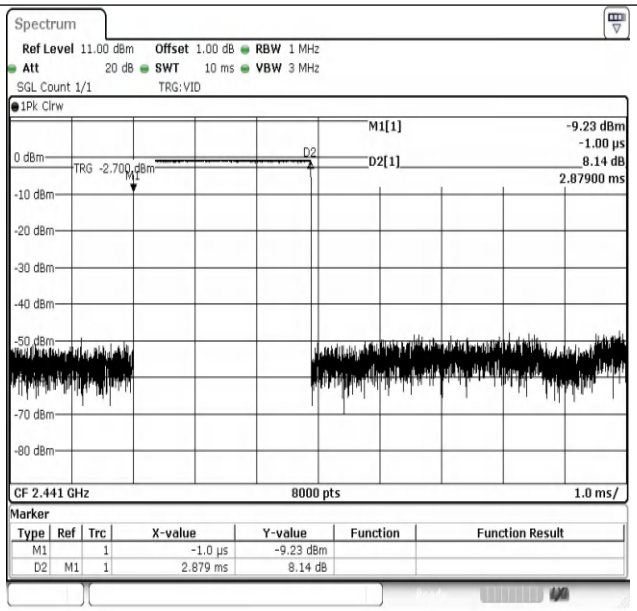

DH5-Ant1-Hop-PASS

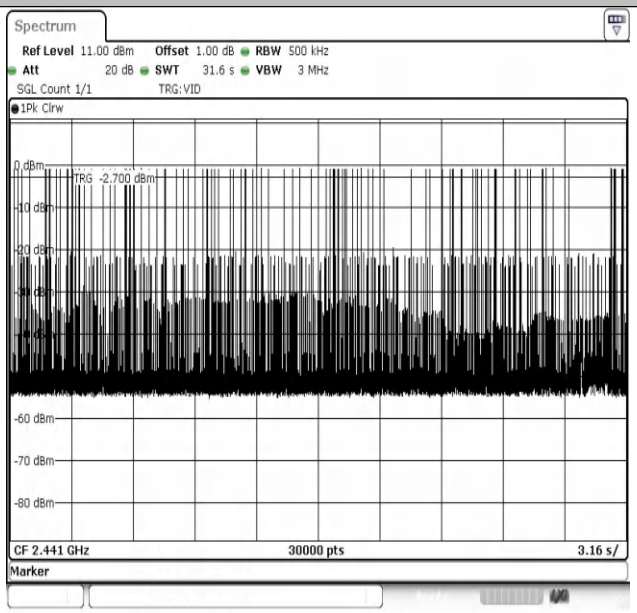

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

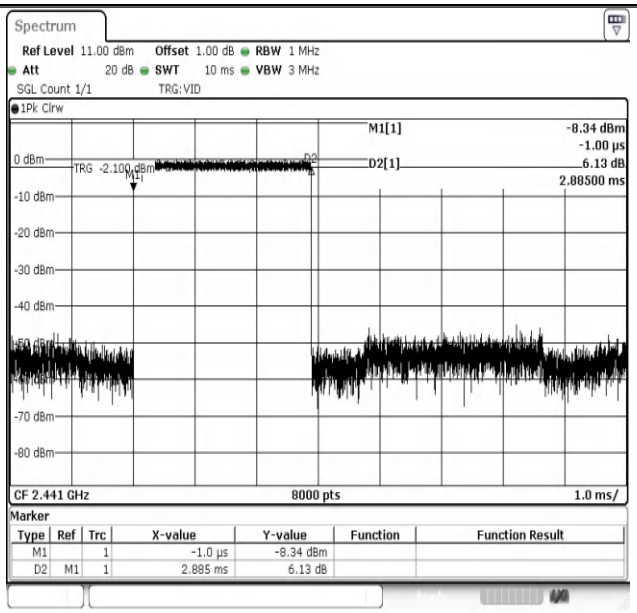

2DH5-Ant1-Hop-PASS

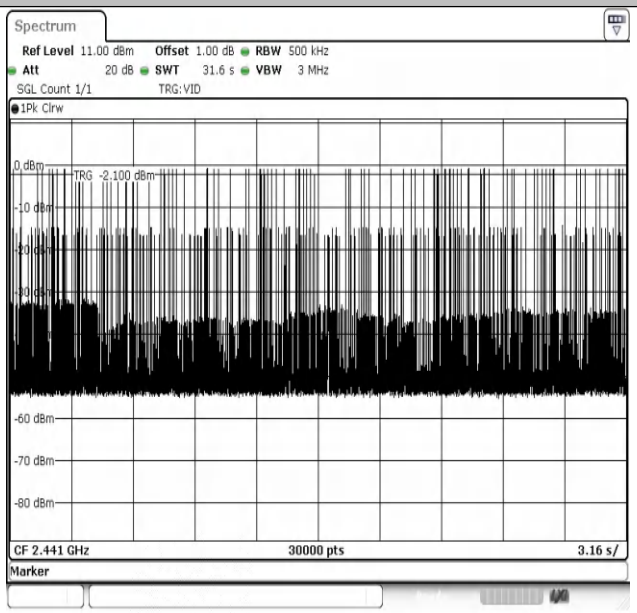

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

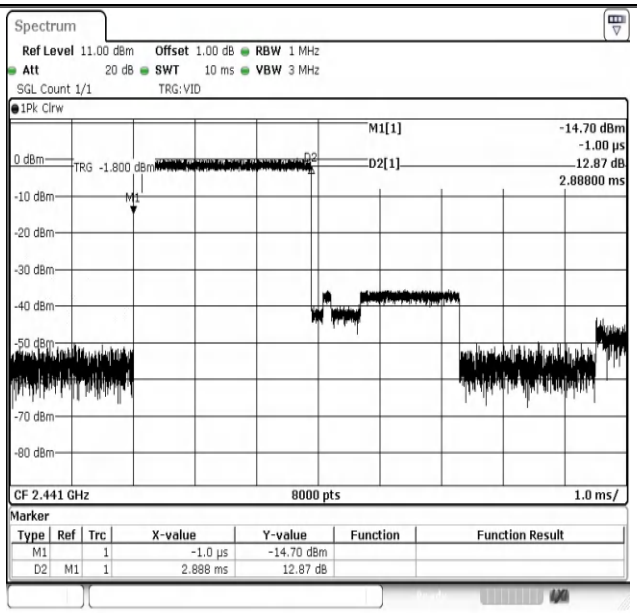

3DH5-Ant1-Hop-PASS

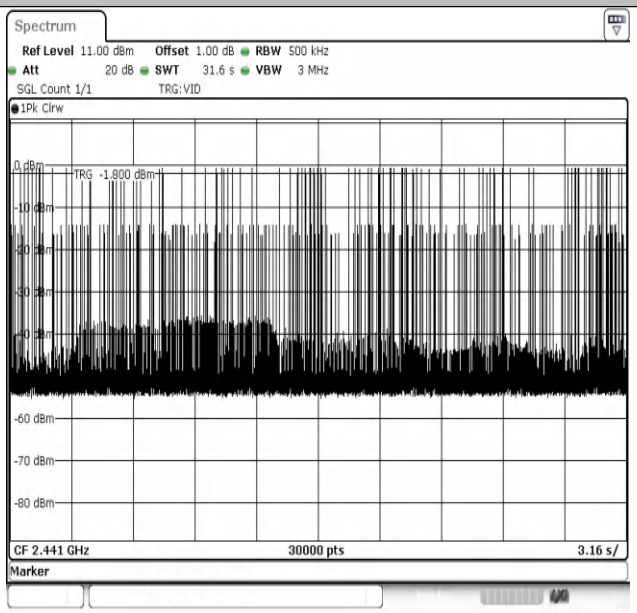

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Appendix F: Number of Hopping Channel

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [Num]	Limit [Num]	Verdict
DH5	Ant1	Hop	79	≥15	PASS
2DH5	Ant1	Hop	79	≥15	PASS
3DH5	Ant1	Hop	79	≥15	PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Test Graphs

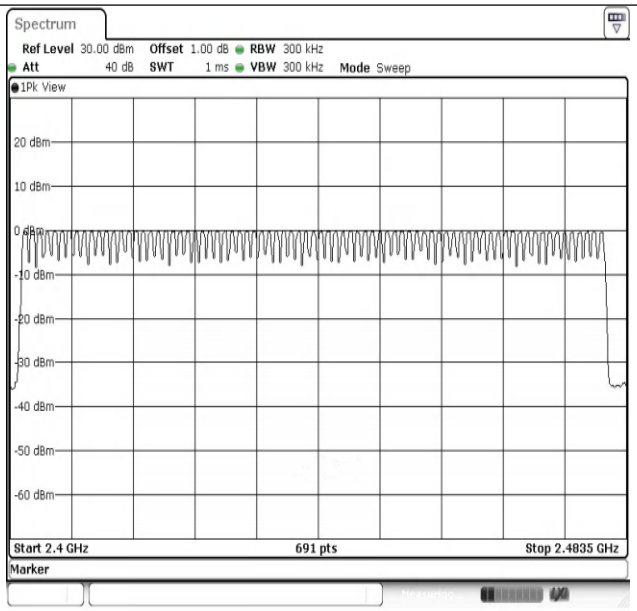

DH5-Ant1-Hop-PASS

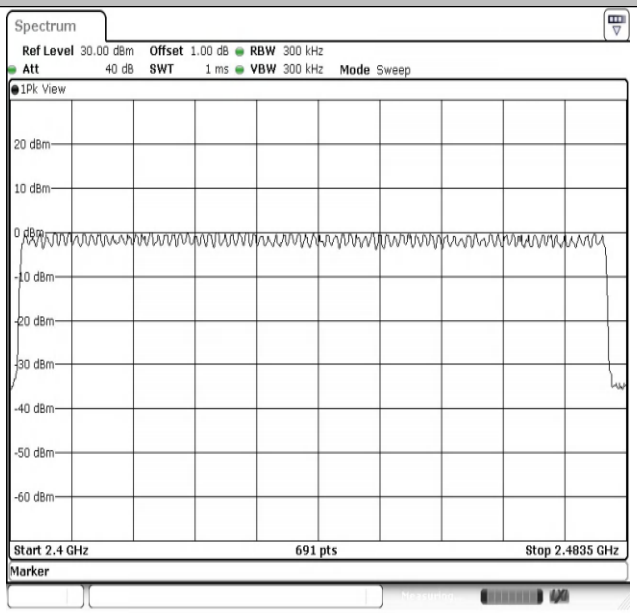

2DH5-Ant1-Hop-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

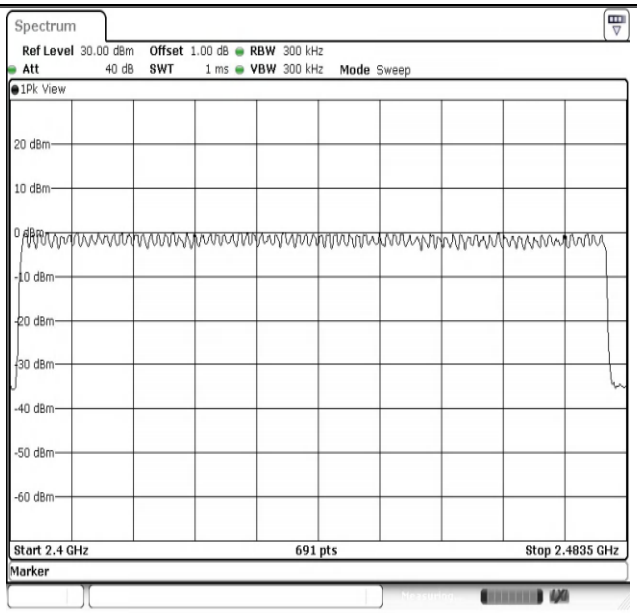

3DH5-Ant1-Hop-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Appendix G: Conducted Band edge

Test Result

Test Mode	Antenna	Ch. Name	Frequency [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	Low	2402	-1.01	-49.24	≤-21.01	PASS
DH5	Ant1	High	2480	-1.24	-48.17	≤-21.24	PASS
DH5	Ant1	Low	Hop_2402	-1.58	-47.95	≤-21.58	PASS
DH5	Ant1	High	Hop_2480	-1.66	-49.31	≤-21.66	PASS
2DH5	Ant1	Low	2402	-0.82	-50.25	≤-20.82	PASS
2DH5	Ant1	High	2480	-1.70	-48.54	≤-21.7	PASS
2DH5	Ant1	Low	Hop_2402	-2.21	-49.8	≤-22.21	PASS
2DH5	Ant1	High	Hop_2480	-4.62	-48.81	≤-24.62	PASS
3DH5	Ant1	Low	2402	-2.02	-49.12	≤-22.02	PASS
3DH5	Ant1	High	2480	-1.52	-48.56	≤-21.52	PASS
3DH5	Ant1	Low	Hop_2402	-2.89	-49	≤-22.89	PASS
3DH5	Ant1	High	Hop_2480	-2.17	-50.42	≤-22.17	PASS

Remark:1. Regarding the spurious emissions from 30MHz to 26.5GHz, the cable lose have been set in the 'offset' of the Spectrum Analyzer during the test.

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Test Graphs

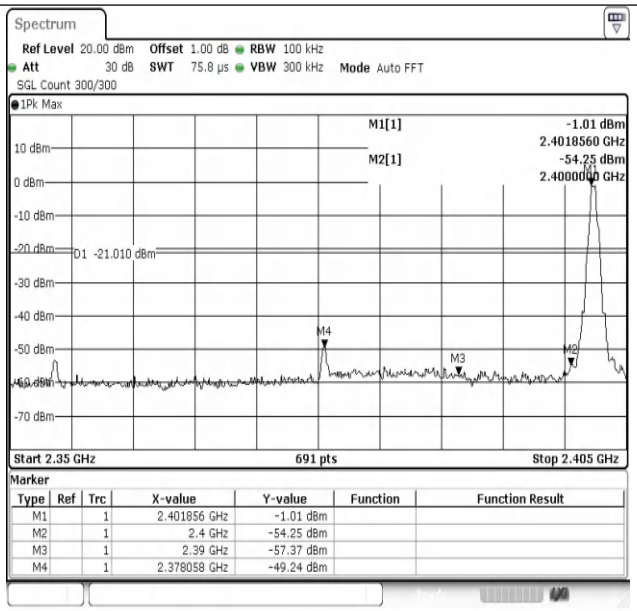

DH5-Ant1-2402-PASS

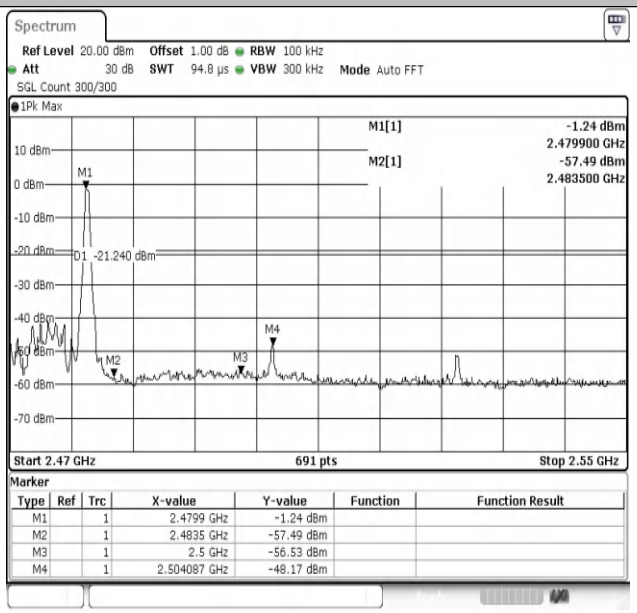

DH5-Ant1-2480-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

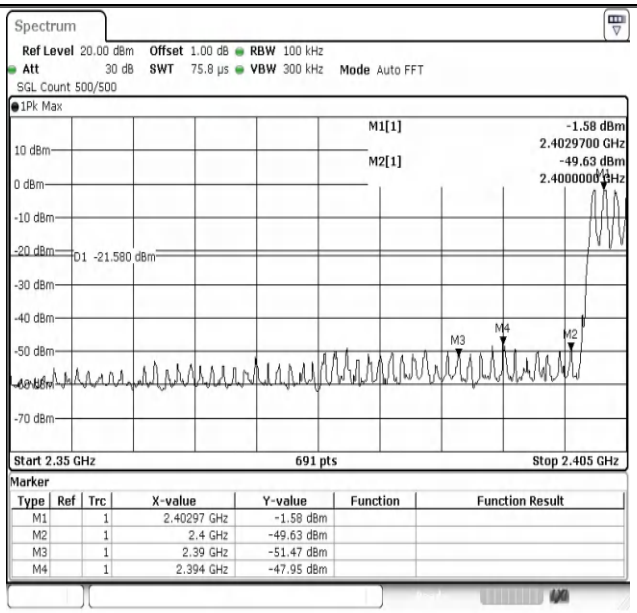

DH5-Ant1-Hop_2402-PASS

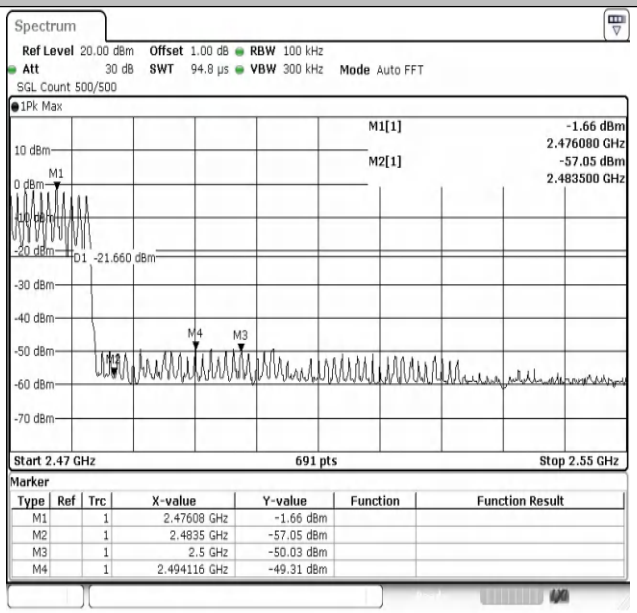

DH5-Ant1-Hop_2480-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

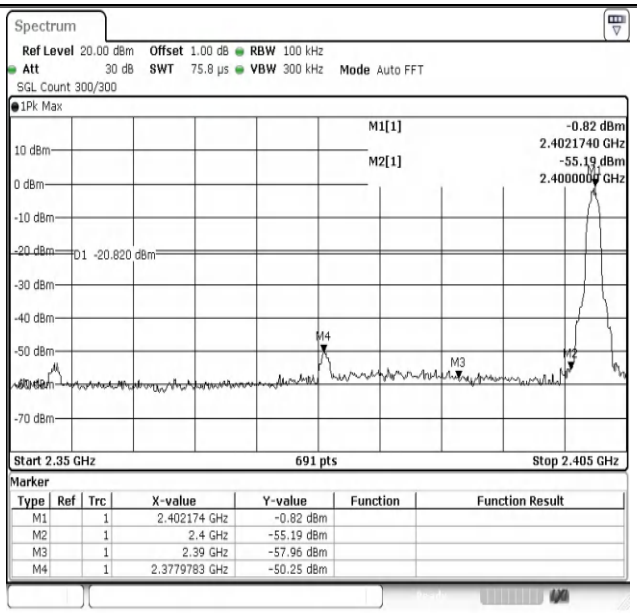

2DH5-Ant1-2402-PASS

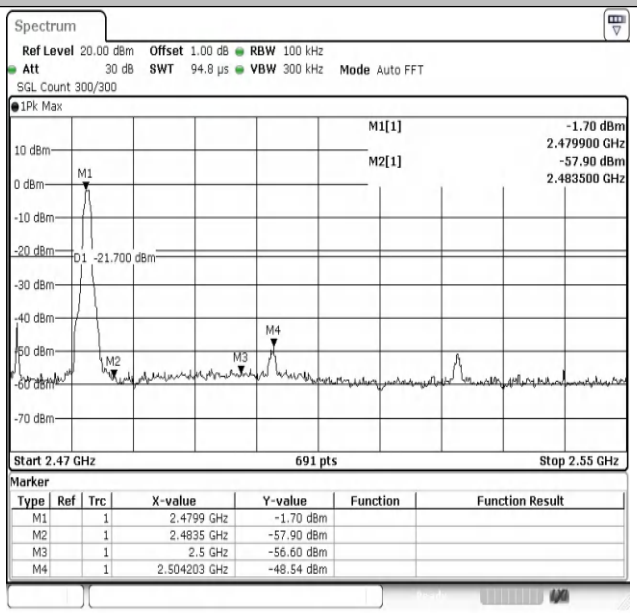

2DH5-Ant1-2480-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

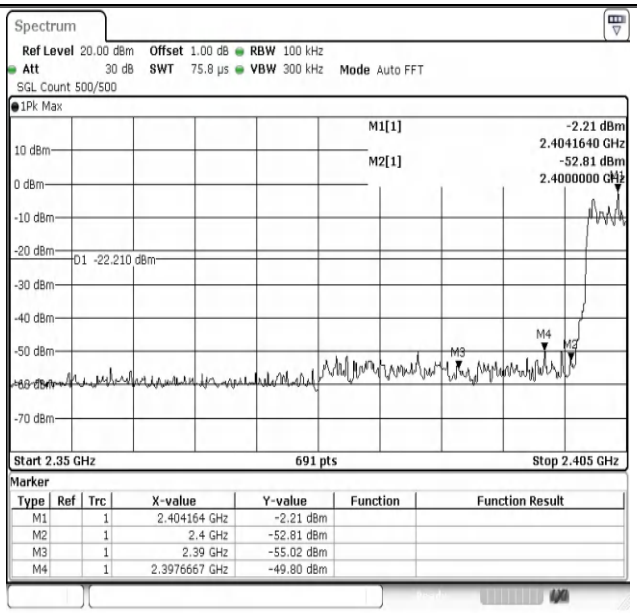

2DH5-Ant1-Hop_2402-PASS

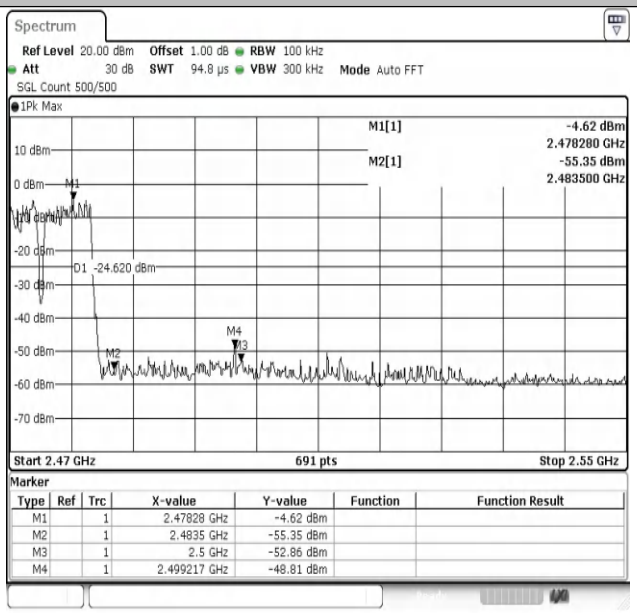

2DH5-Ant1-Hop_2480-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

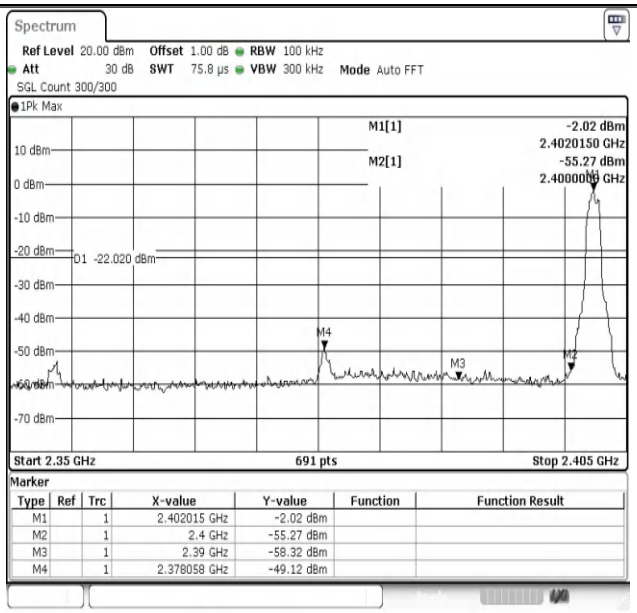

3DH5-Ant1-2402-PASS

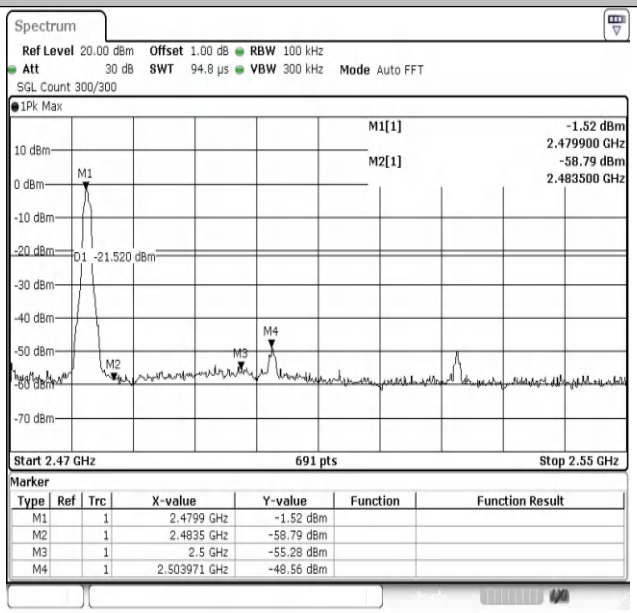

3DH5-Ant1-2480-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

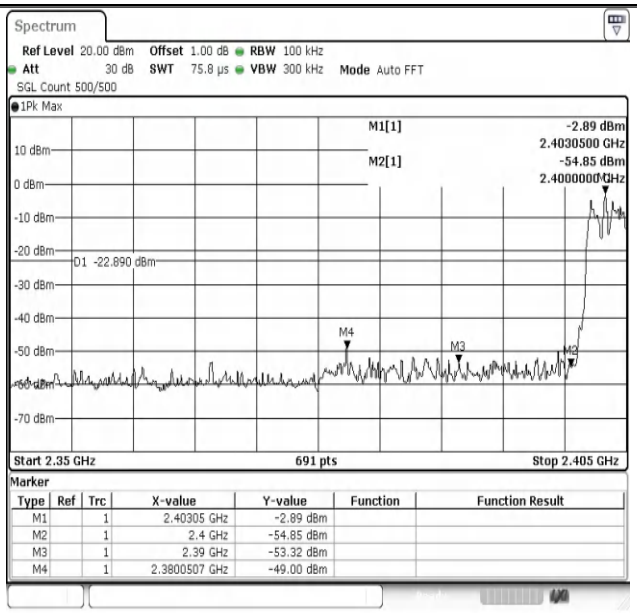

3DH5-Ant1-Hop_2402-PASS

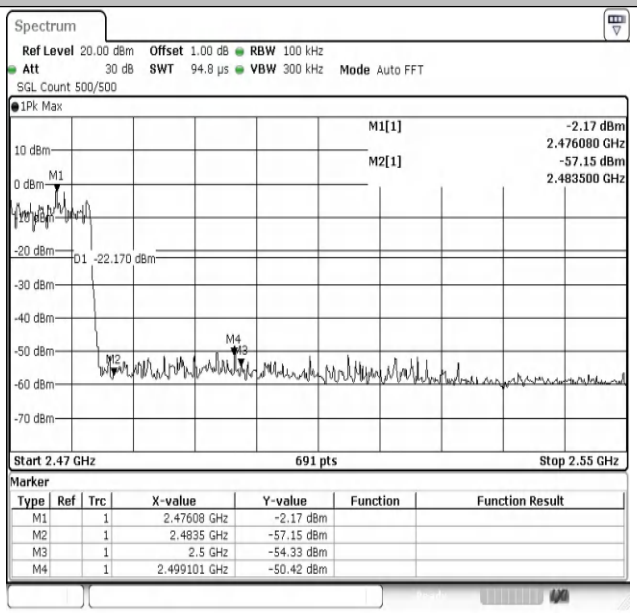

3DH5-Ant1-Hop_2480-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix H: Conducted Spurious Emission

Test Result

Test Mode	Antenna	Frequency[MHz]	Freq. Range [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	2402	0~Reference	-1.33	-1.33	---	PASS
DH5	Ant1	2402	30~1000	-1.33	-56.92	≤-21.33	PASS
DH5	Ant1	2402	1000~26500	-1.33	-39.33	≤-21.33	PASS
DH5	Ant1	2441	0~Reference	-1.55	-1.55	---	PASS
DH5	Ant1	2441	30~1000	-1.55	-57.65	≤-21.55	PASS
DH5	Ant1	2441	1000~26500	-1.55	-41.82	≤-21.55	PASS
DH5	Ant1	2480	0~Reference	-1.32	-1.32	---	PASS
DH5	Ant1	2480	30~1000	-1.32	-57.6	≤-21.32	PASS
DH5	Ant1	2480	1000~26500	-1.32	-40.34	≤-21.32	PASS
2DH5	Ant1	2402	0~Reference	-2.19	-2.19	---	PASS
2DH5	Ant1	2402	30~1000	-2.19	-58.62	≤-22.19	PASS
2DH5	Ant1	2402	1000~26500	-2.19	-42.54	≤-22.19	PASS
2DH5	Ant1	2441	0~Reference	-2.49	-2.49	---	PASS
2DH5	Ant1	2441	30~1000	-2.49	-58.26	≤-22.49	PASS
2DH5	Ant1	2441	1000~26500	-2.49	-44.5	≤-22.49	PASS
2DH5	Ant1	2480	0~Reference	-2.05	-2.05	---	PASS
2DH5	Ant1	2480	30~1000	-2.05	-58.21	≤-22.05	PASS
2DH5	Ant1	2480	1000~26500	-2.05	-42.91	≤-22.05	PASS
3DH5	Ant1	2402	0~Reference	-2.61	-2.61	---	PASS
3DH5	Ant1	2402	30~1000	-2.61	-57.96	≤-22.61	PASS
3DH5	Ant1	2402	1000~26500	-2.61	-40.4	≤-22.61	PASS
3DH5	Ant1	2441	0~Reference	-1.16	-1.16	---	PASS
3DH5	Ant1	2441	30~1000	-1.16	-58.3	≤-21.16	PASS
3DH5	Ant1	2441	1000~26500	-1.16	-43.09	≤-21.16	PASS
3DH5	Ant1	2480	0~Reference	-1.61	-1.61	---	PASS
3DH5	Ant1	2480	30~1000	-1.61	-58.23	≤-21.61	PASS
3DH5	Ant1	2480	1000~26500	-1.61	-42.68	≤-21.61	PASS

Remark:Regarding the spurious emissions from 30MHz to 26.5GHz, the cable lose have been set in the 'TDF' of the Spectrum Analyzer during the test.

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs

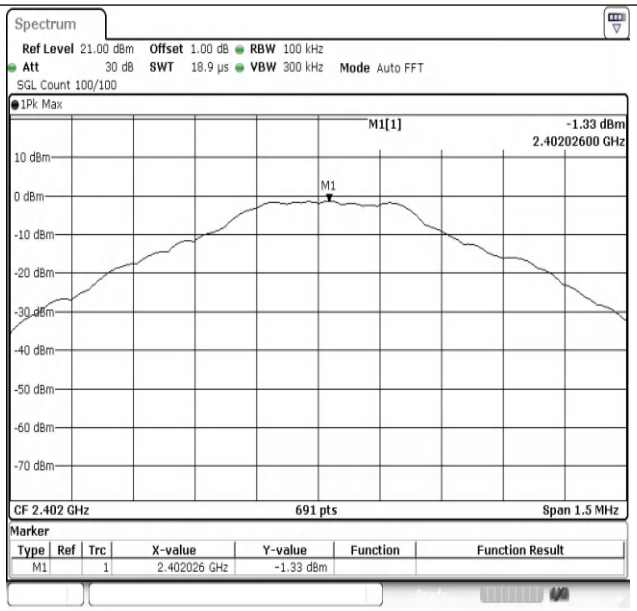

DH5-Ant1-2402-0~Reference-PASS

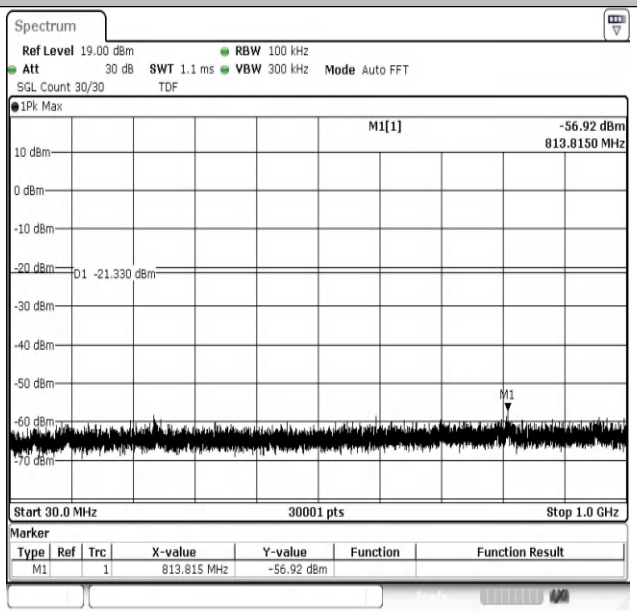

DH5-Ant1-2402-30~1000-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

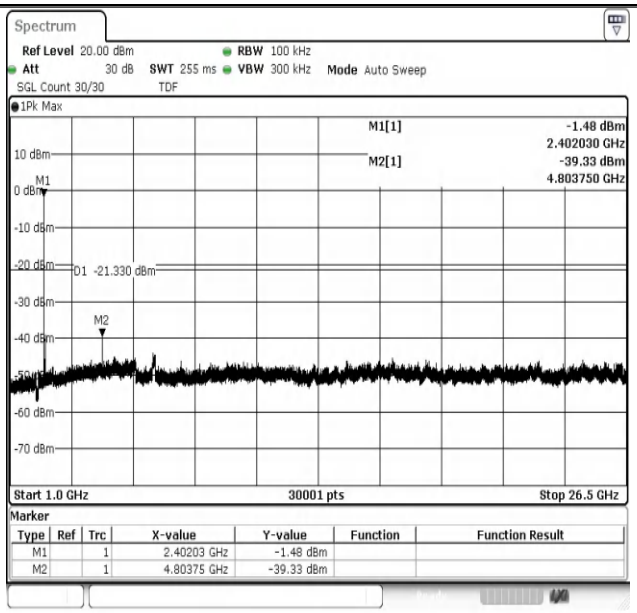

DH5-Ant1-2402-1000~26500-PASS

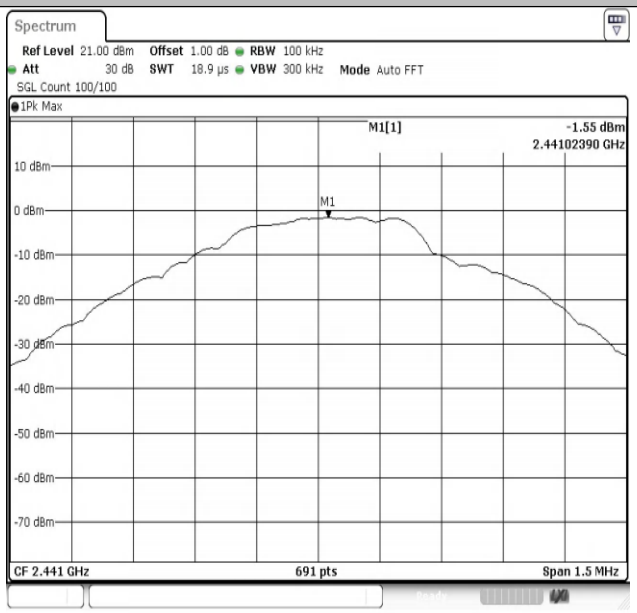

DH5-Ant1-2441-0~Reference-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

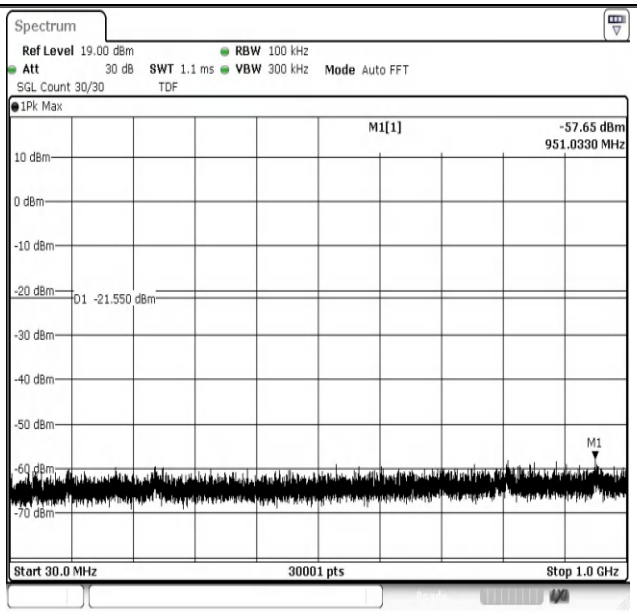

DH5-Ant1-2441-30~1000-PASS

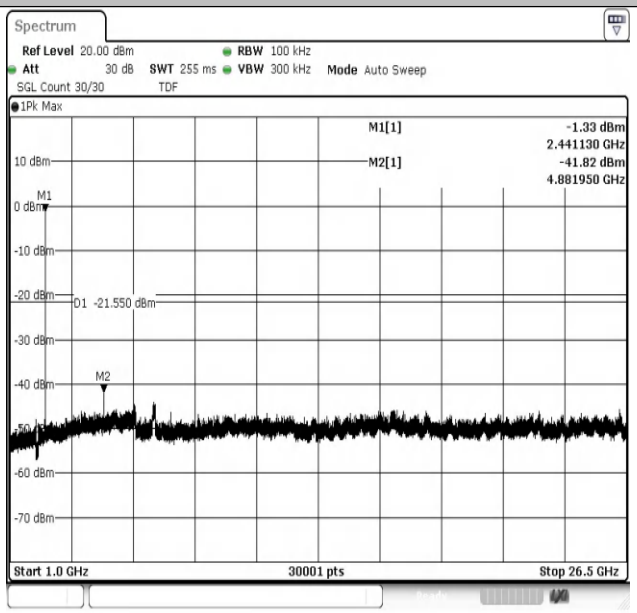

DH5-Ant1-2441-1000~26500-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

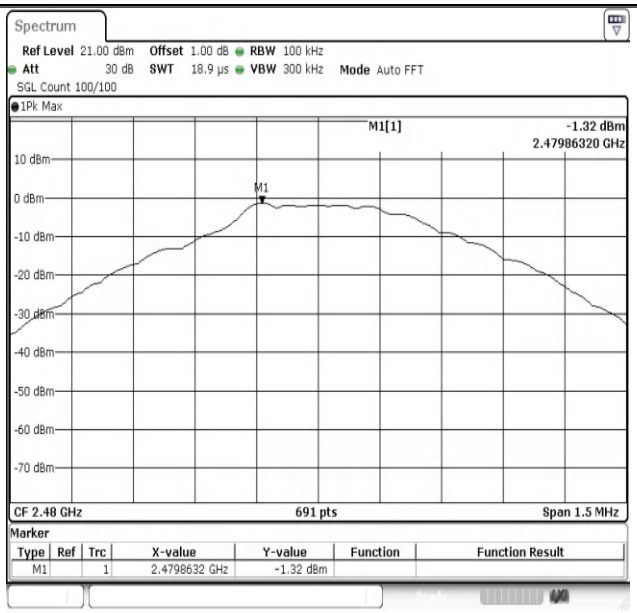

DH5-Ant1-2480-0~Reference-PASS

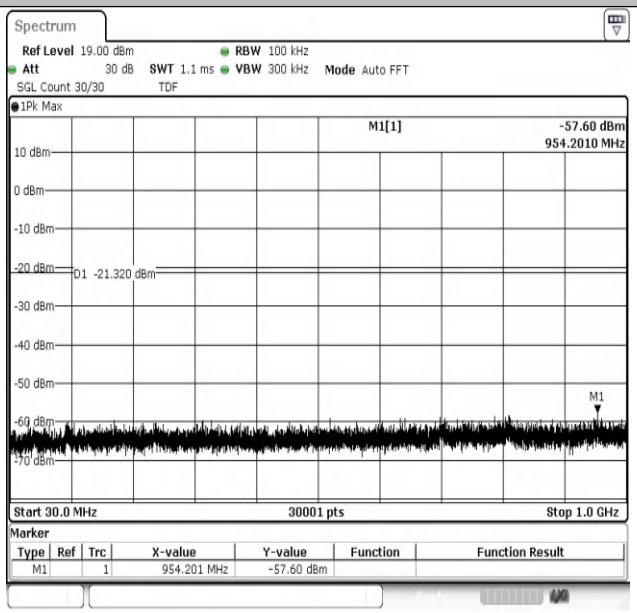

DH5-Ant1-2480-30~1000-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

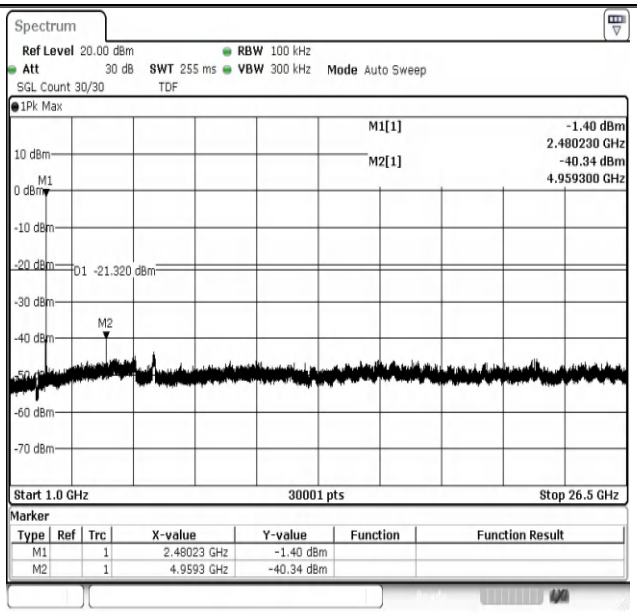

DH5-Ant1-2480-1000~26500-PASS

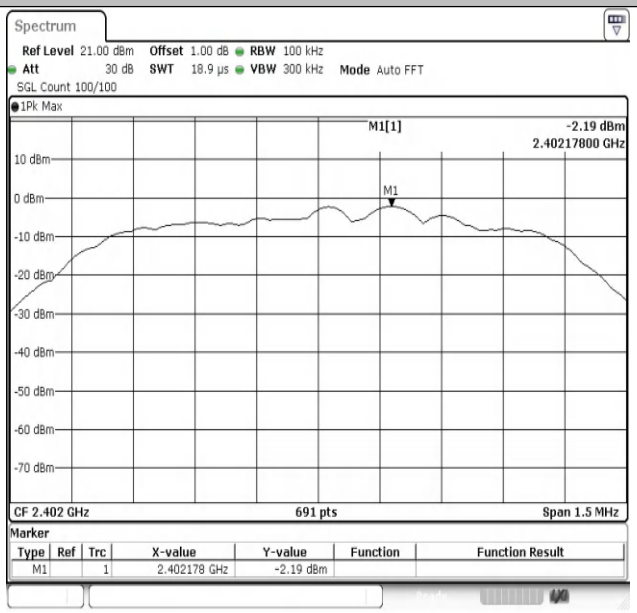

2DH5-Ant1-2402-0~Reference-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

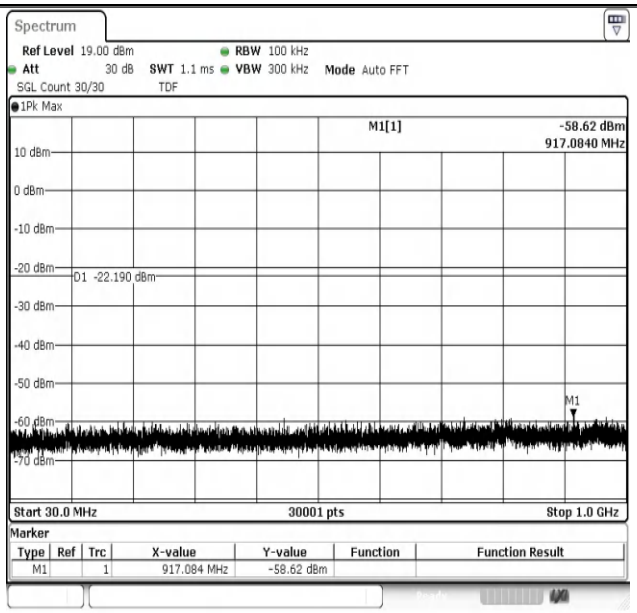

2DH5-Ant1-2402-30~1000-PASS

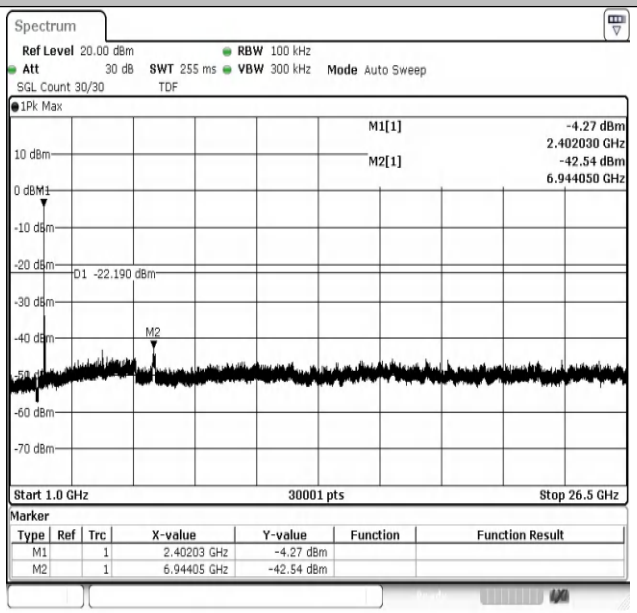

2DH5-Ant1-2402-1000~26500-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

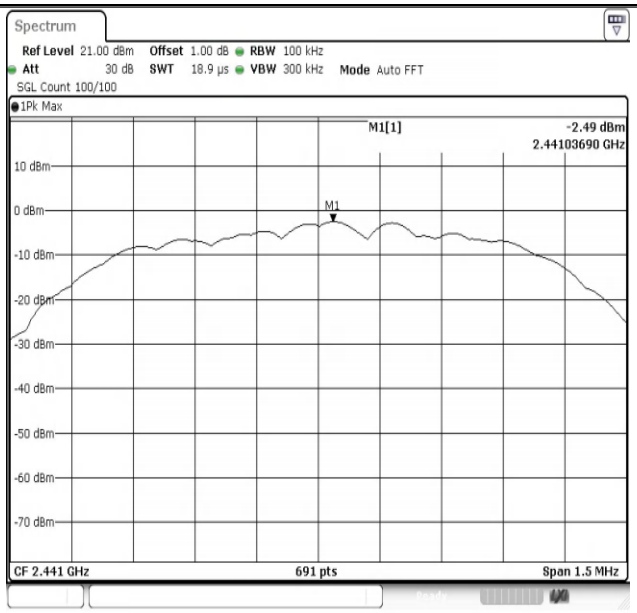

2DH5-Ant1-2441-0~Reference-PASS

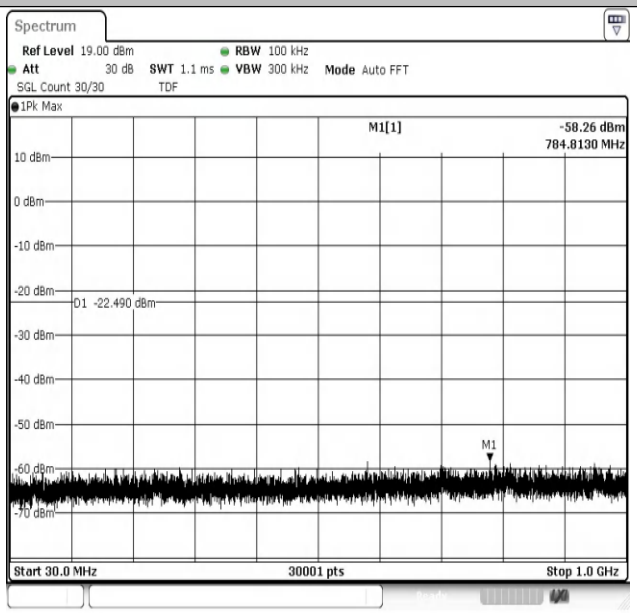

2DH5-Ant1-2441-30~1000-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

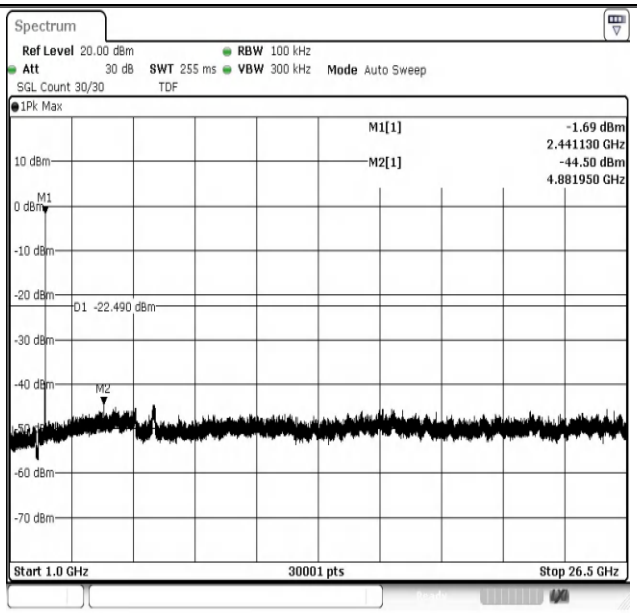

2DH5-Ant1-2441-1000~26500-PASS

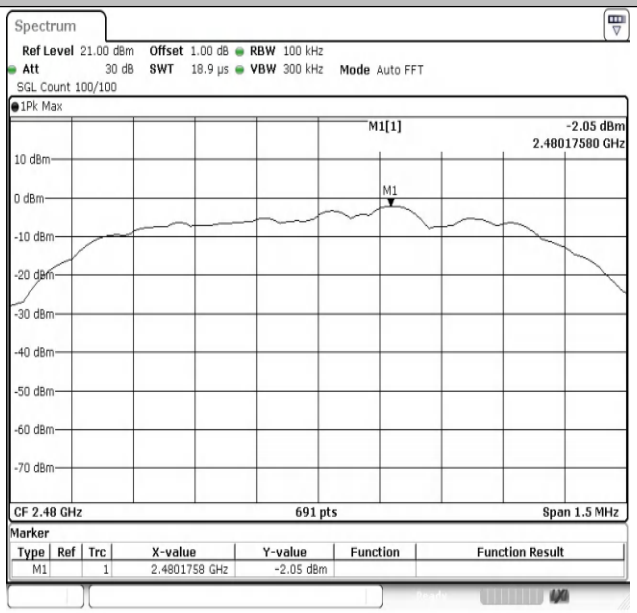

2DH5-Ant1-2480-0~Reference-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

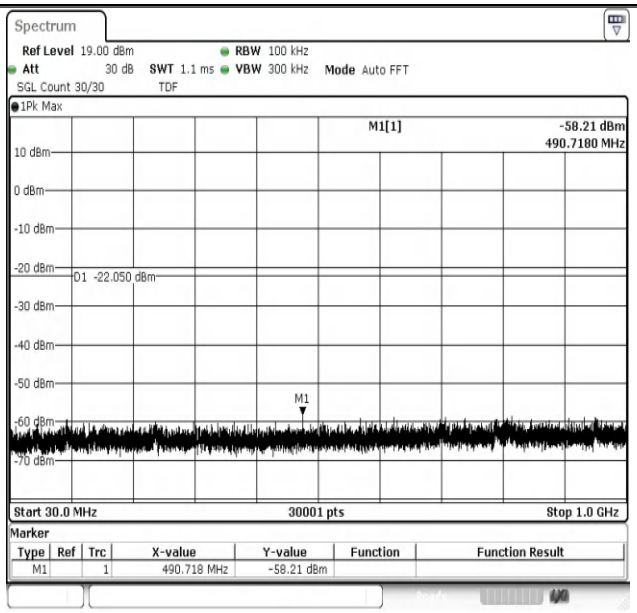

2DH5-Ant1-2480-30~1000-PASS

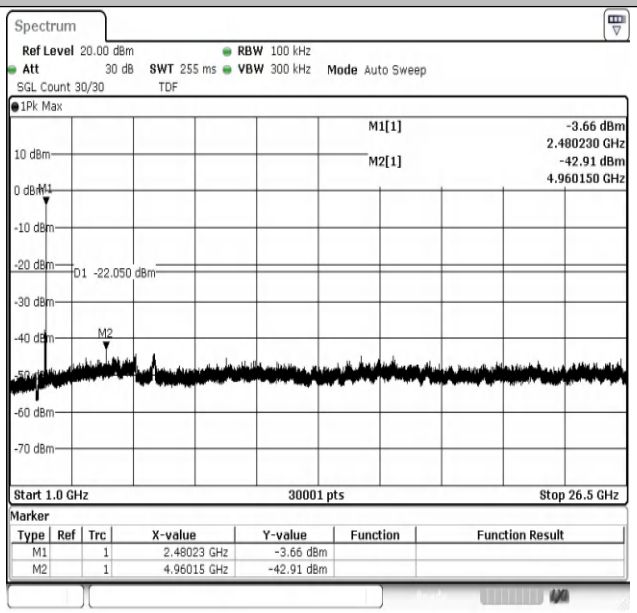

2DH5-Ant1-2480-1000~26500-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

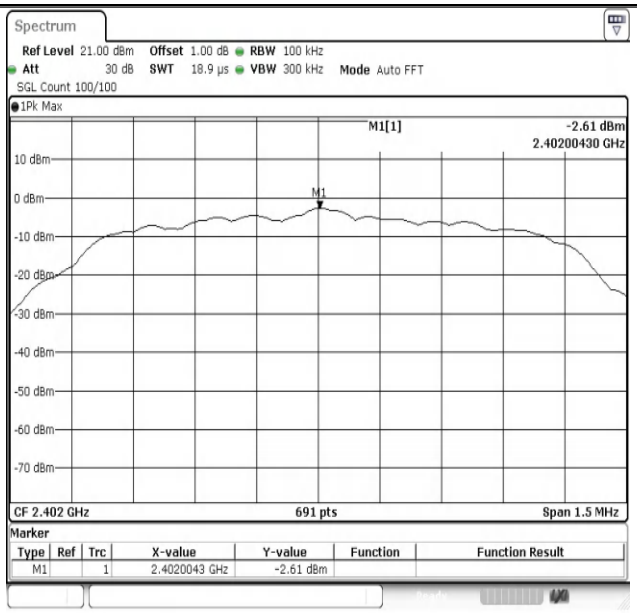

3DH5-Ant1-2402-0~Reference-PASS

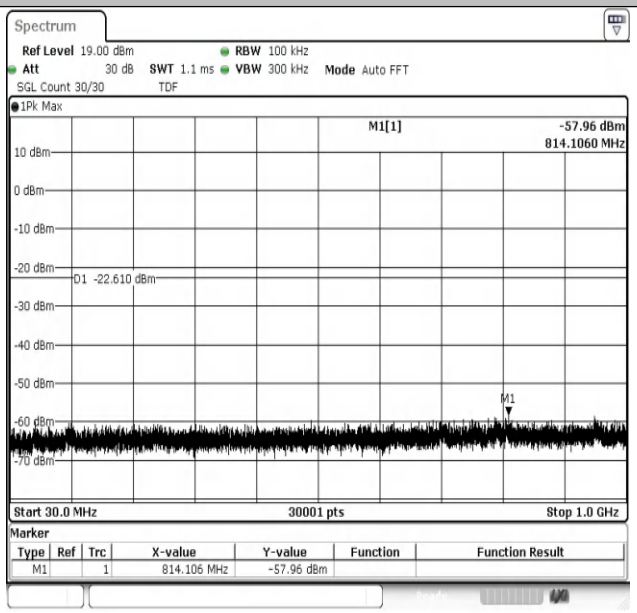

3DH5-Ant1-2402-30~1000-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

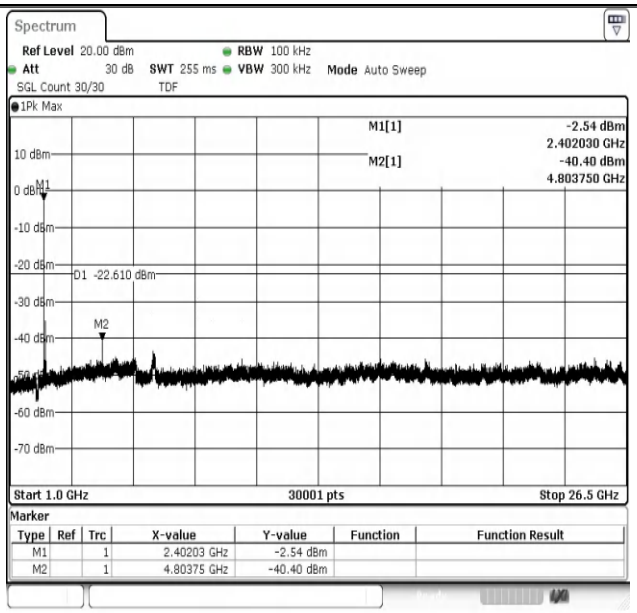

3DH5-Ant1-2402-1000~26500-PASS

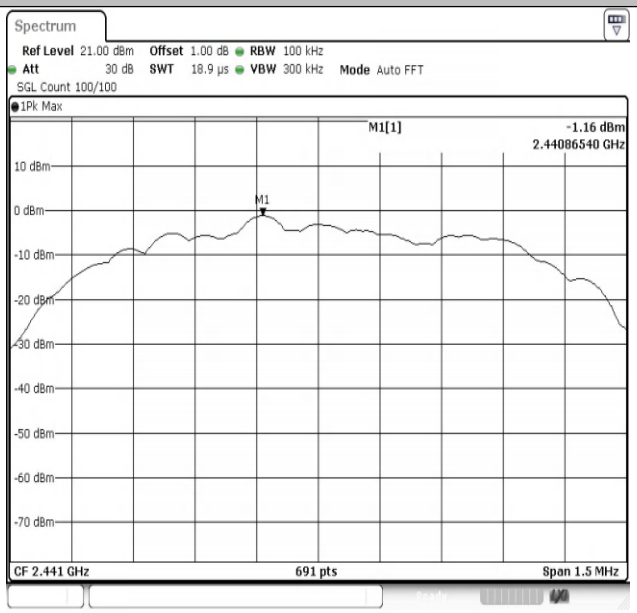

3DH5-Ant1-2441-0~Reference-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

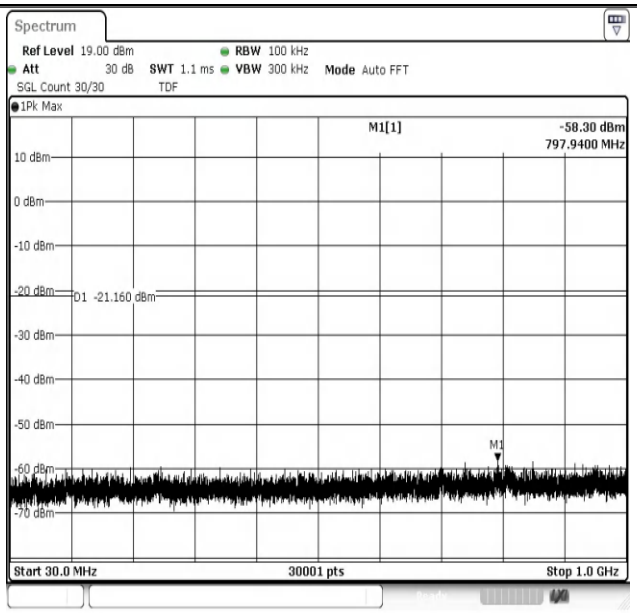

3DH5-Ant1-2441-30~1000-PASS

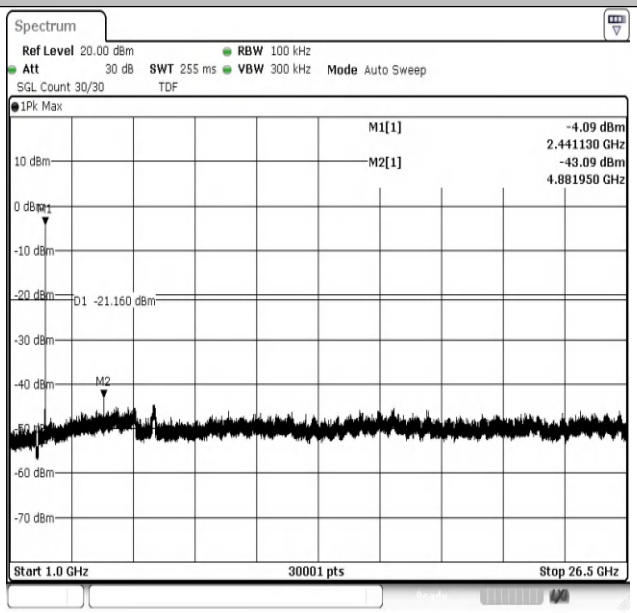

3DH5-Ant1-2441-1000~26500-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

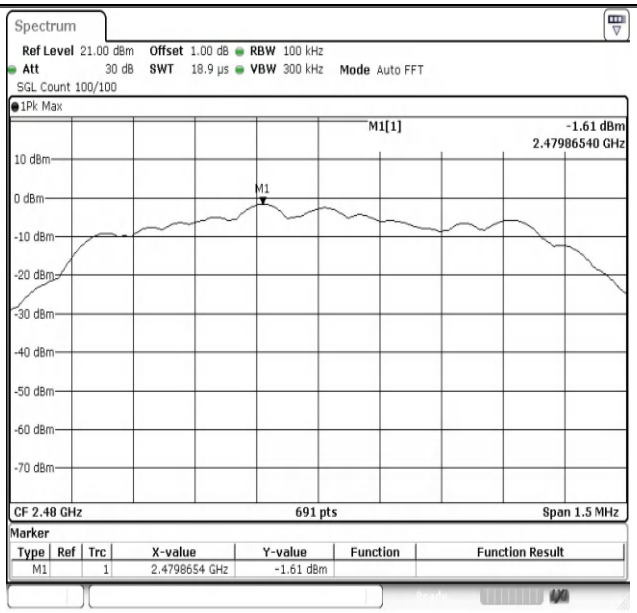

3DH5-Ant1-2480-0~Reference-PASS

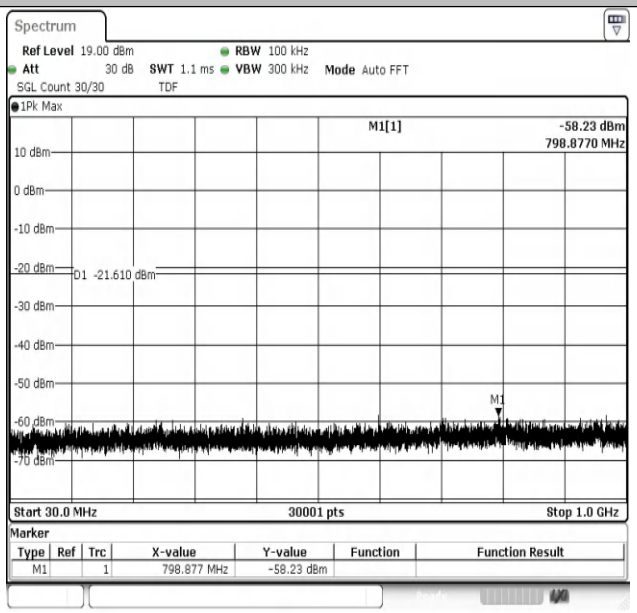

3DH5-Ant1-2480-30~1000-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

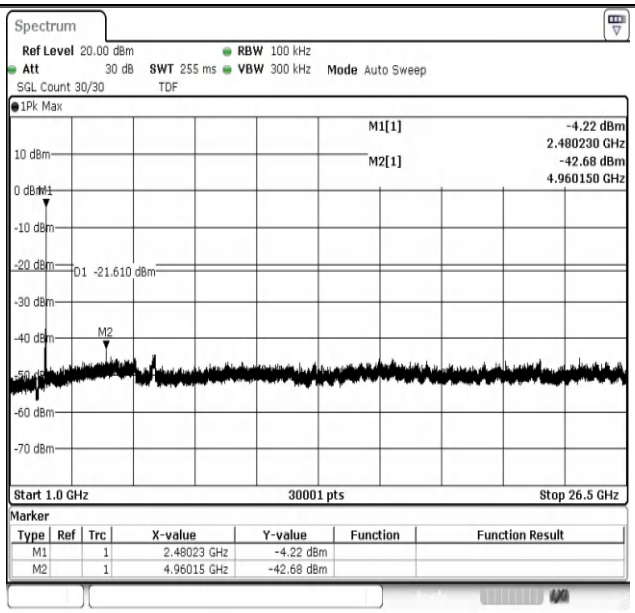

3DH5-Ant1-2480-1000~26500-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Appendix I: Duty Cycle

Test Result

Test Mode	Antenna	Frequency[MHz]	ON Time [ms]	Period [ms]	Duty Cycle [%]	Duty Cycle Factor[dB]
DH5	Ant1	2402	2.88	3.75	76.80	1.15
DH5	Ant1	2441	2.88	3.75	76.80	1.15
DH5	Ant1	2480	2.88	3.75	76.80	1.15
2DH5	Ant1	2402	2.90	3.77	76.92	1.14
2DH5	Ant1	2441	2.90	3.77	76.92	1.14
2DH5	Ant1	2480	2.89	3.76	76.86	1.14
3DH5	Ant1	2402	2.89	3.76	76.86	1.14
3DH5	Ant1	2441	2.90	3.77	76.92	1.14
3DH5	Ant1	2480	2.88	3.75	76.80	1.15

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs

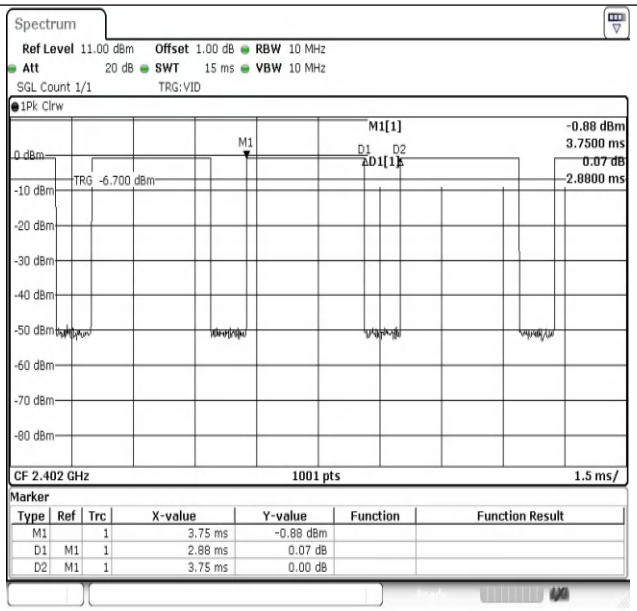

NTNV-DH5-Ant1-2402

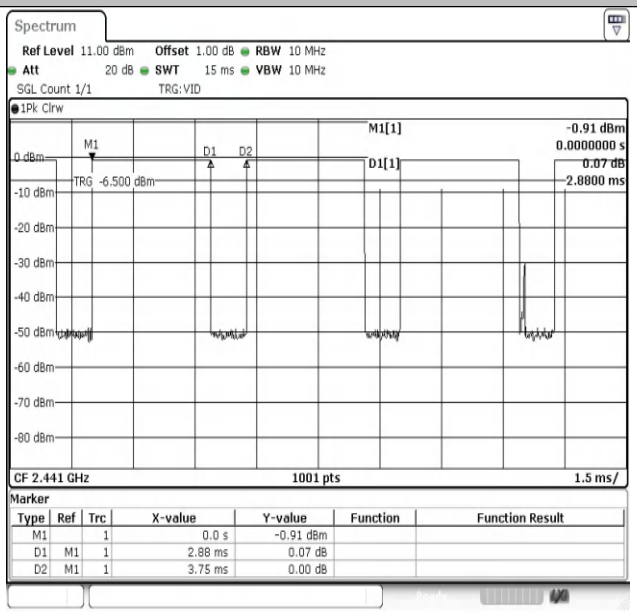

NTNV-DH5-Ant1-2441

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

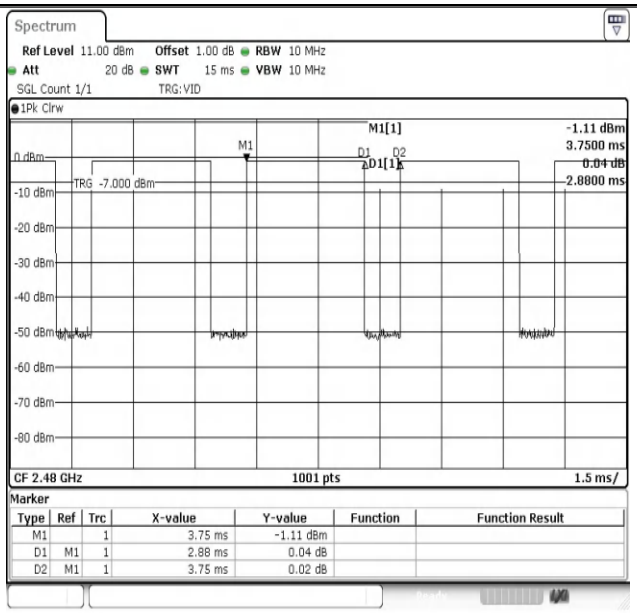

NTNV-DH5-Ant1-2480

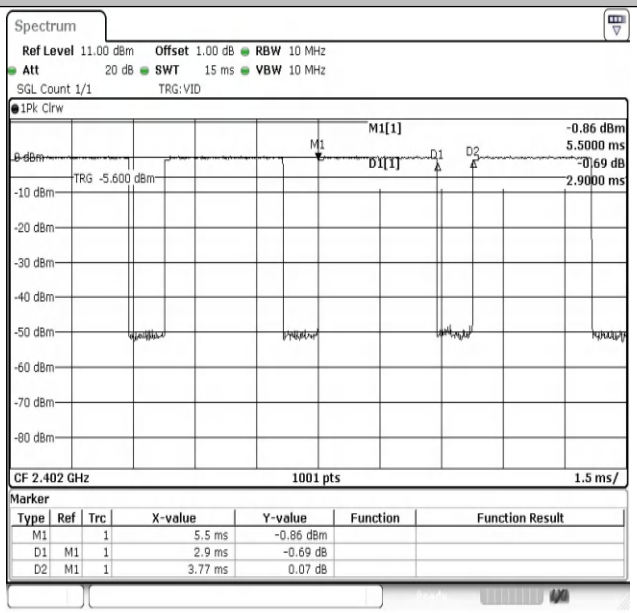

NTNV-2DH5-Ant1-2402

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

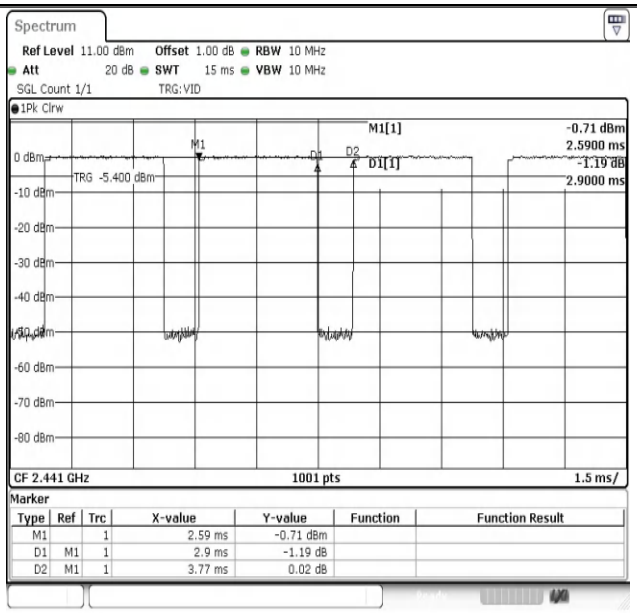

NTNV-2DH5-Ant1-2441

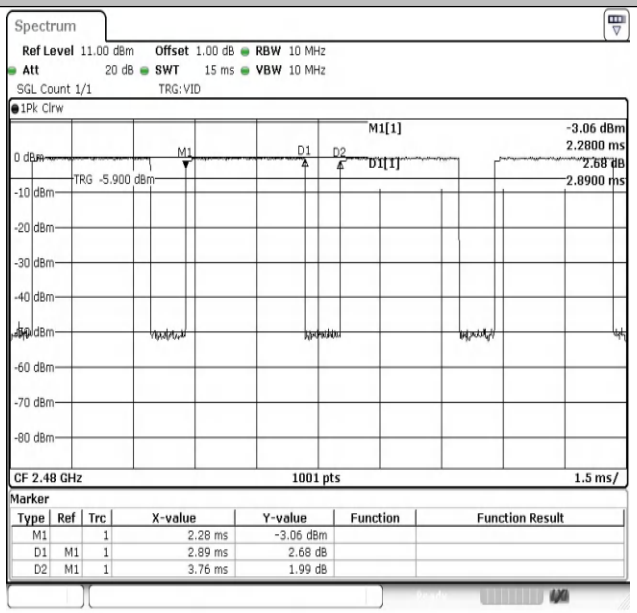

NTNV-2DH5-Ant1-2480

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

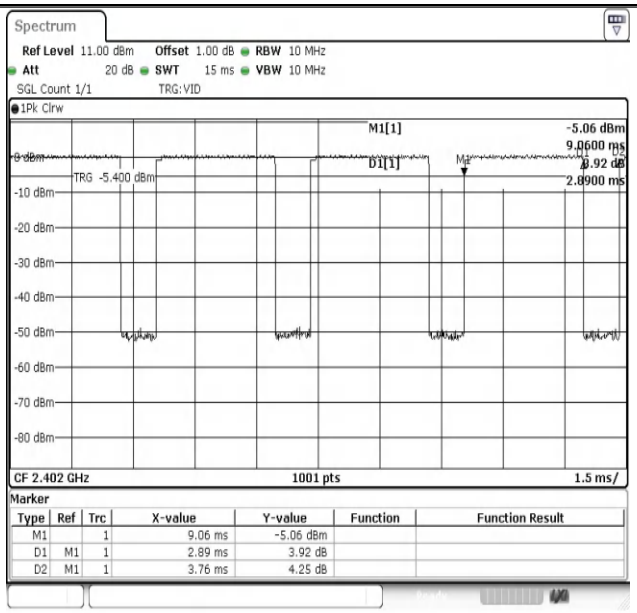

NTNV-3DH5-Ant1-2402

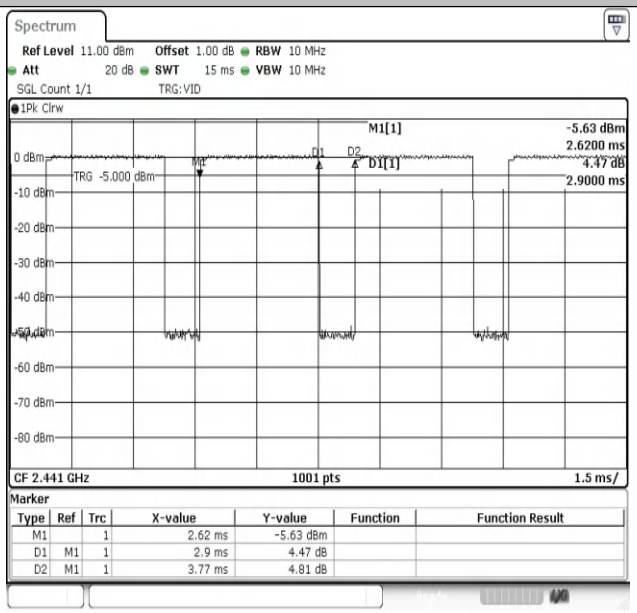

NTNV-3DH5-Ant1-2441

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.
Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

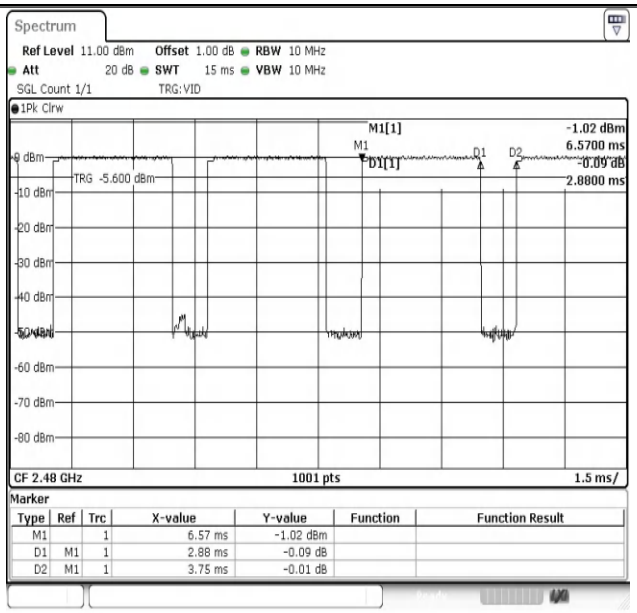

NTNV-3DH5-Ant1-2480

---End---

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.