


Appendix Test Data

Report No.:	1812C60046112501-01	Test Sample No.:	1-2-2
Start Test Date:	2026-1-19	Finish Test Date:	2026-1-21
Test Engineer:	Pearl Ao	Auditor:	Justin Feng
Temperature:	20.5°C	Relative Humidity:	60%
Pressure:	101kPa		

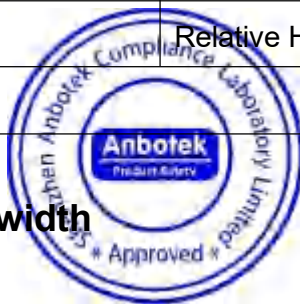


Appendix A: 20dB Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	20db EBW[MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	0.954	2401.499	2402.453	---	---
DH5	Ant1	2441	1.014	2440.445	2441.459	---	---
DH5	Ant1	2480	0.963	2479.493	2480.456	---	---
2DH5	Ant1	2402	1.317	2401.304	2402.621	---	---
2DH5	Ant1	2441	1.278	2440.334	2441.612	---	---
2DH5	Ant1	2480	1.314	2479.307	2480.621	---	---
3DH5	Ant1	2402	1.308	2401.307	2402.615	---	---
3DH5	Ant1	2441	1.290	2440.319	2441.609	---	---
3DH5	Ant1	2480	1.311	2479.316	2480.627	---	---

Test Graphs

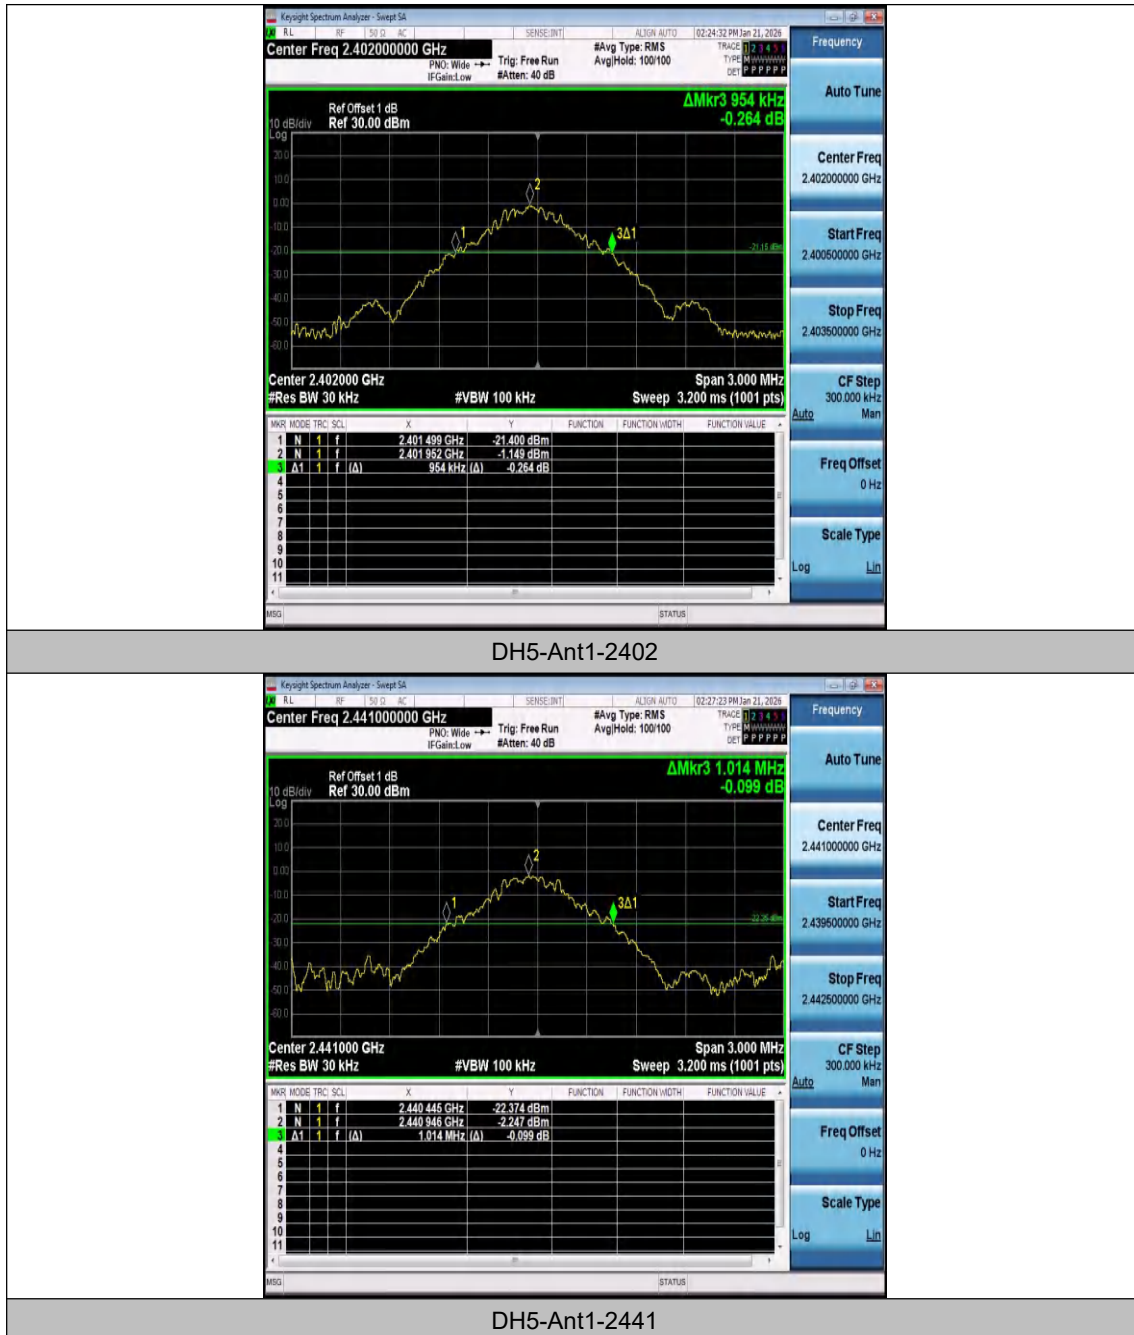



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com







Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	0.87092	2401.5254	2402.3963	---	---
DH5	Ant1	2441	0.90344	2440.5110	2441.4144	---	---
DH5	Ant1	2480	0.88947	2479.5136	2480.4031	---	---
2DH5	Ant1	2402	1.1961	2401.3669	2402.5630	---	---
2DH5	Ant1	2441	1.2128	2440.3516	2441.5644	---	---
2DH5	Ant1	2480	1.1894	2479.3698	2480.5592	---	---
3DH5	Ant1	2402	1.1910	2401.3714	2402.5624	---	---
3DH5	Ant1	2441	1.2035	2440.3599	2441.5634	---	---
3DH5	Ant1	2480	1.2016	2479.3645	2480.5661	---	---

Test Graphs







Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

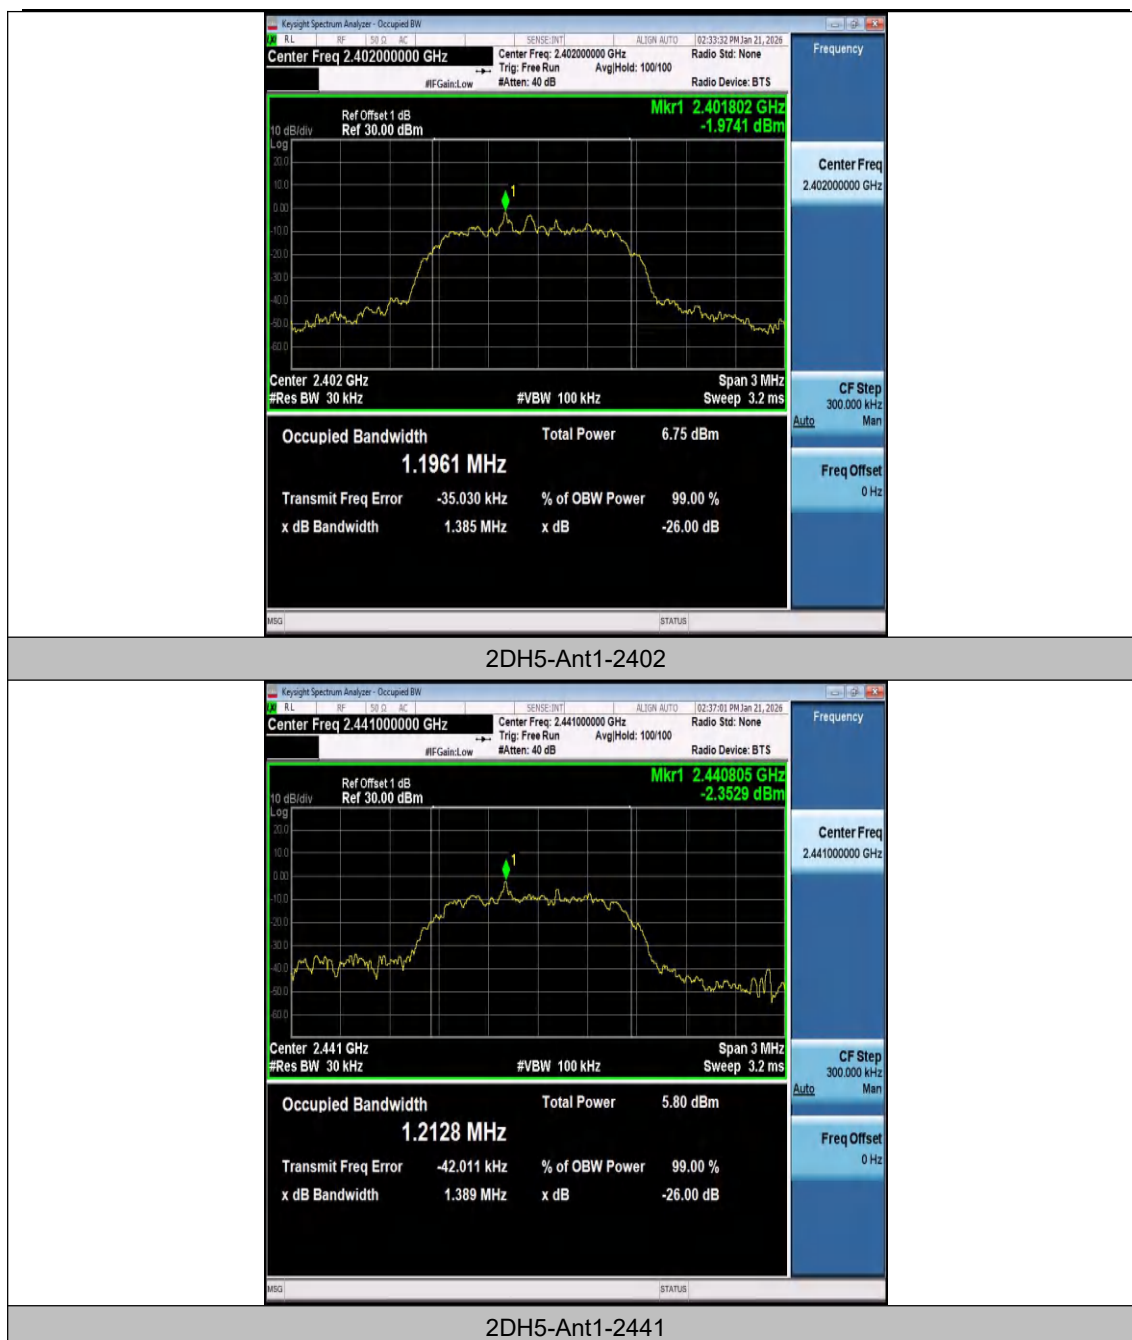

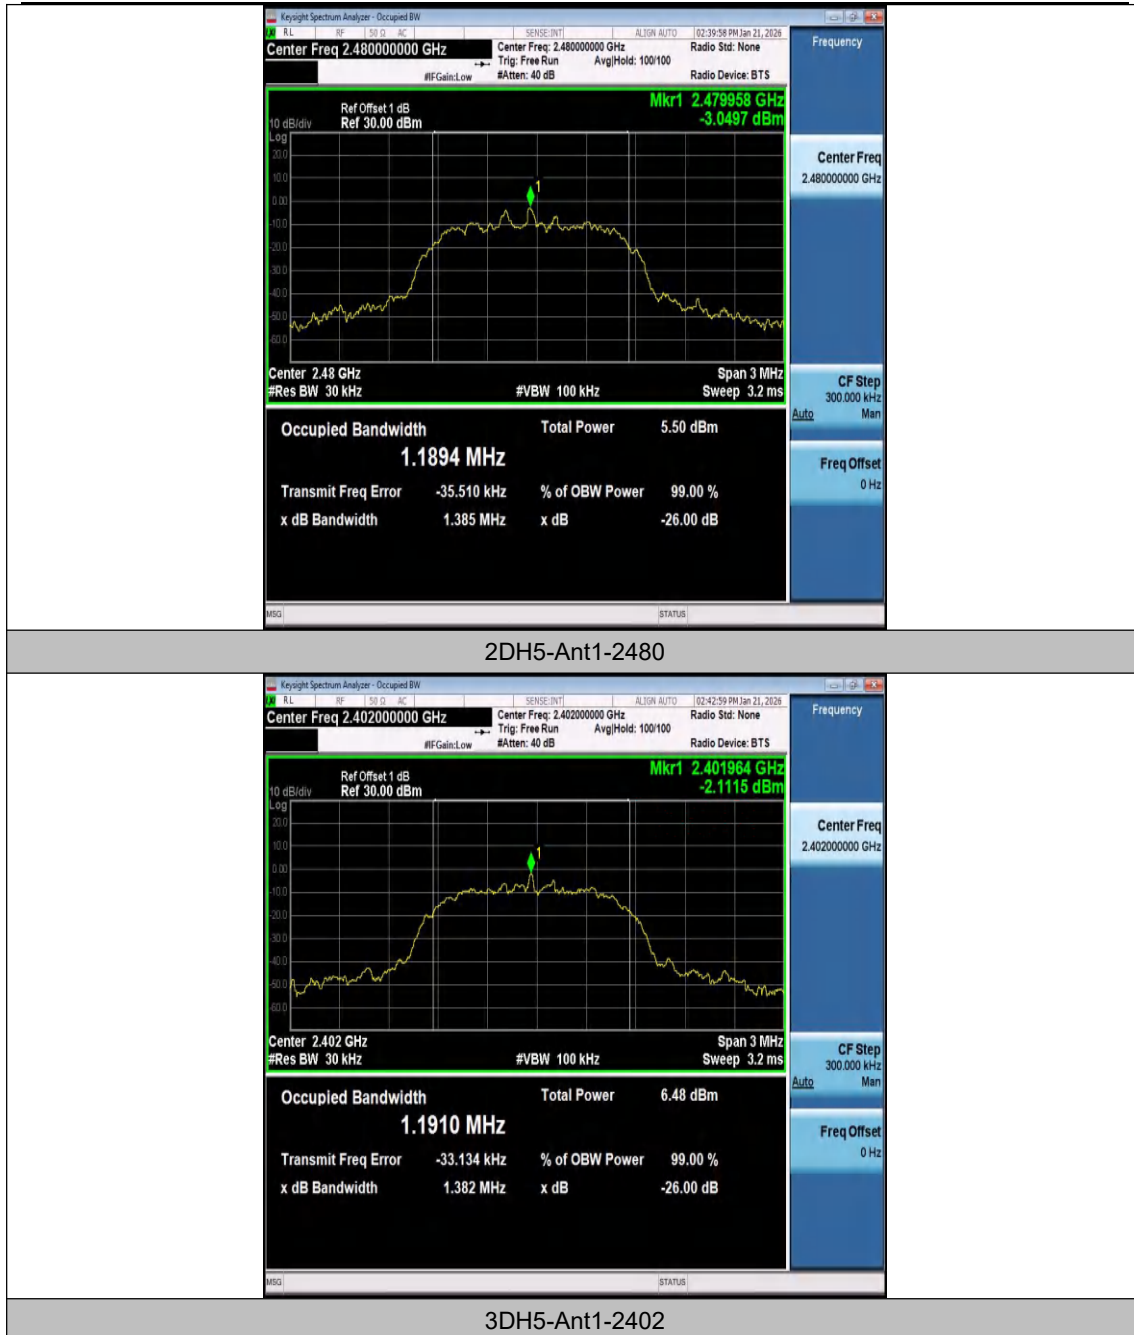

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix C: Maximum Conducted Output Power

Test Result Peak

Test Mode	Antenna	Frequency[MHz]	Conducted Peak Power[dBm]	Conducted Limit[dBm]	Verdict
DH5	Ant1	2402	0.86	≤20.97	PASS
DH5	Ant1	2441	0.79	≤20.97	PASS
DH5	Ant1	2480	-0.48	≤20.97	PASS
2DH5	Ant1	2402	1.54	≤20.97	PASS
2DH5	Ant1	2441	1.25	≤20.97	PASS
2DH5	Ant1	2480	0.24	≤20.97	PASS
3DH5	Ant1	2402	1.90	≤20.97	PASS
3DH5	Ant1	2441	1.66	≤20.97	PASS
3DH5	Ant1	2480	0.56	≤20.97	PASS

Test Graphs

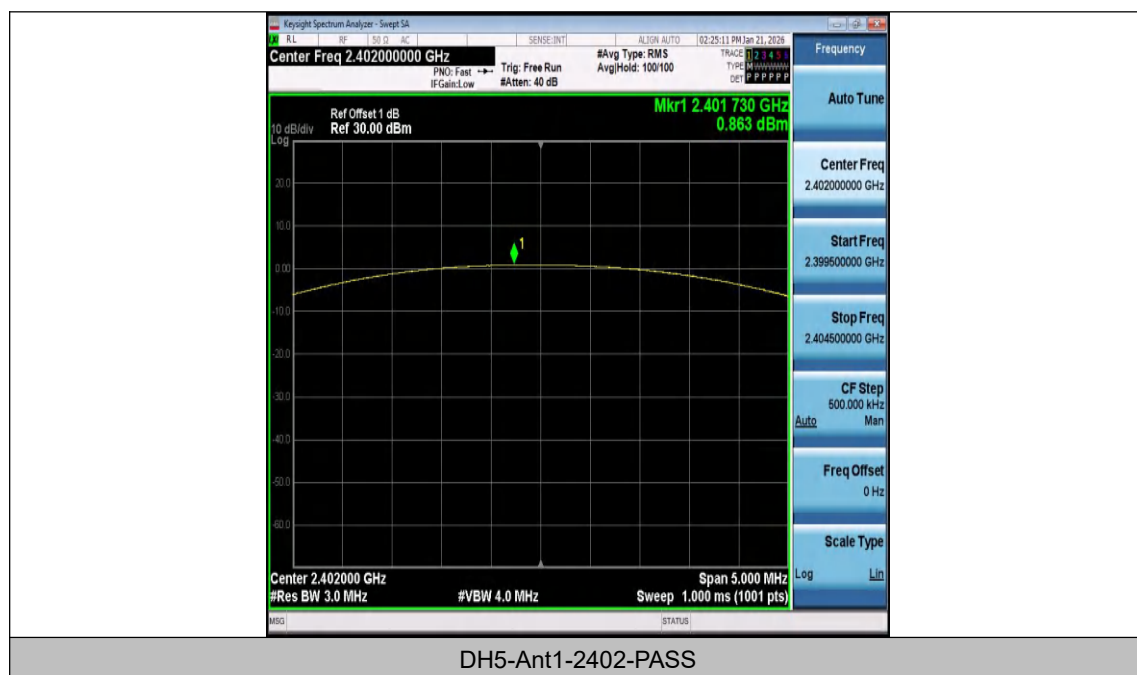


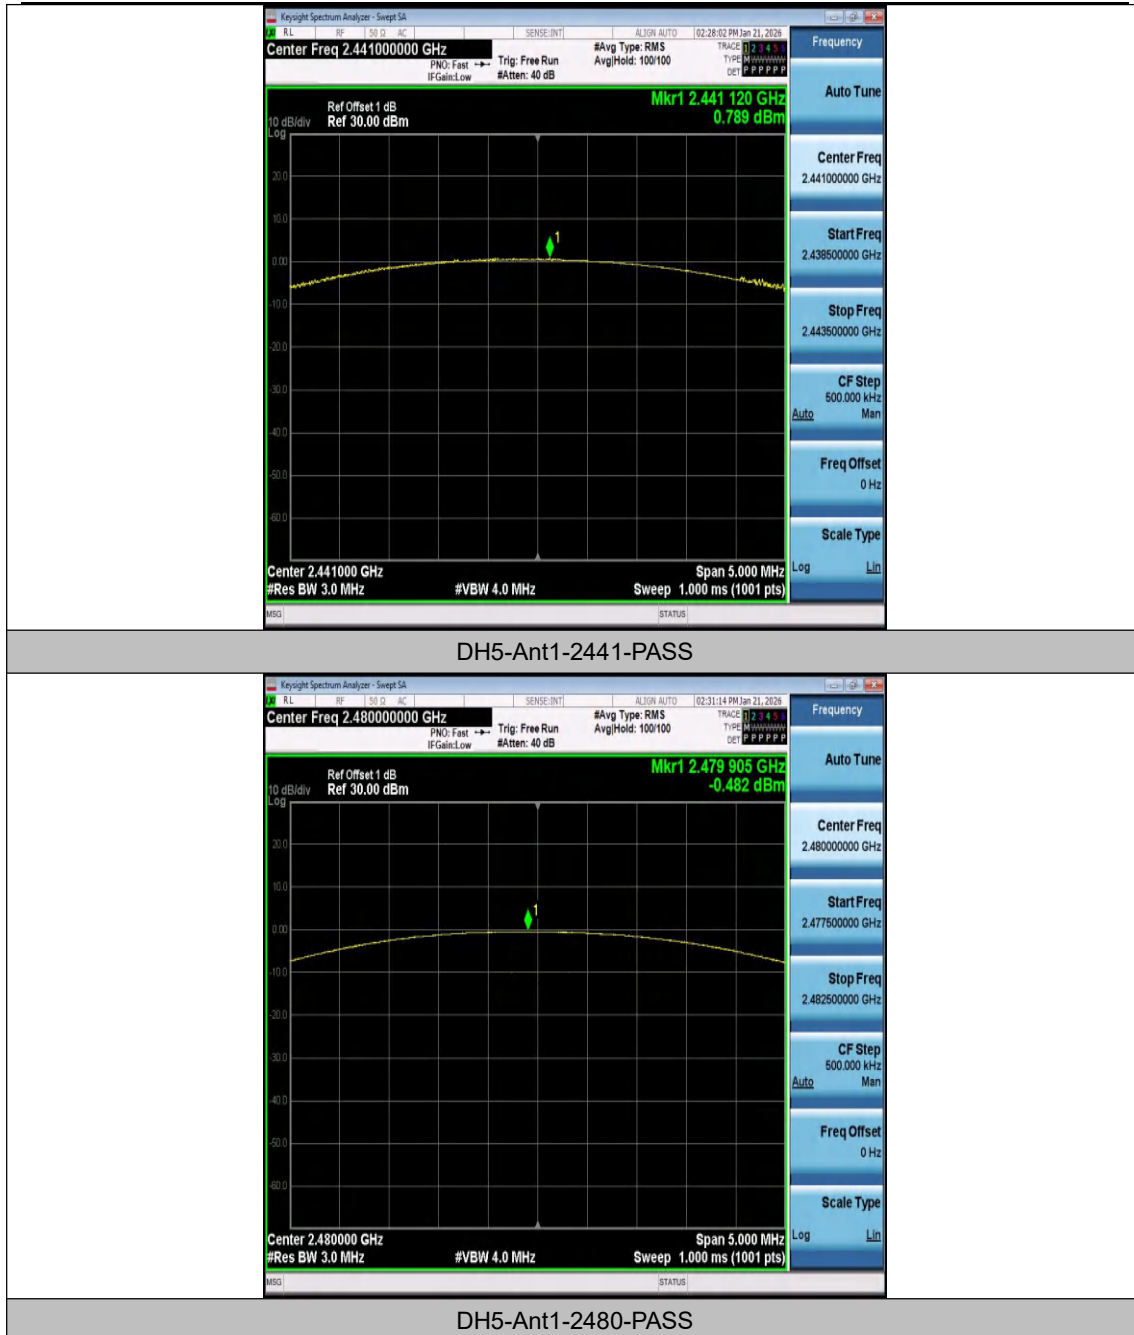

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

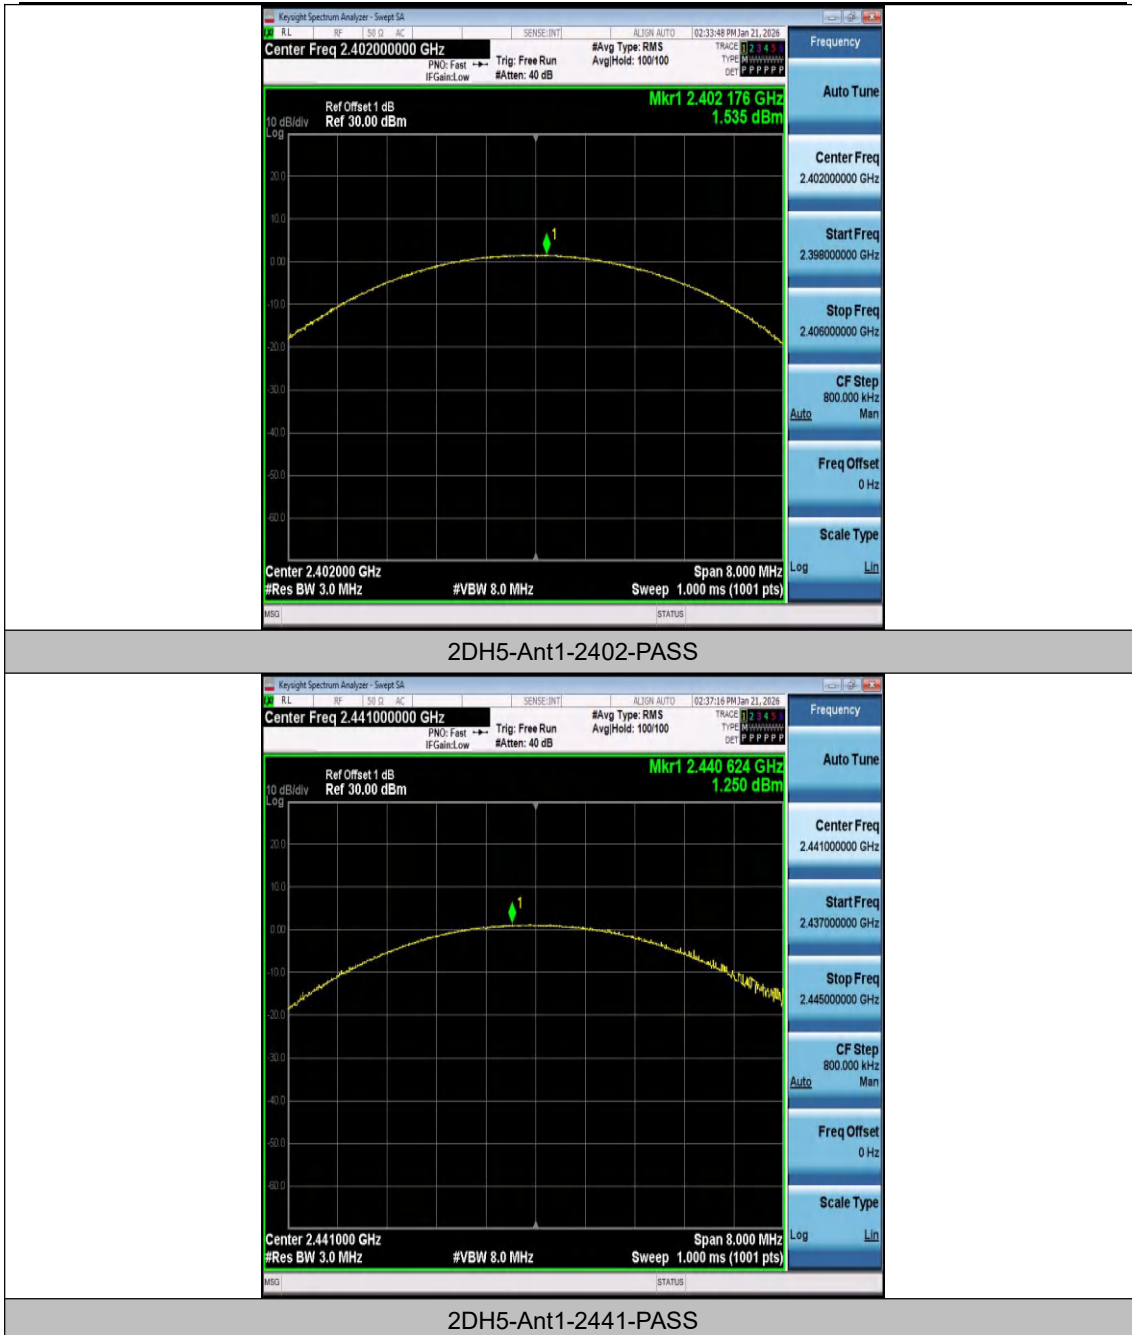

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

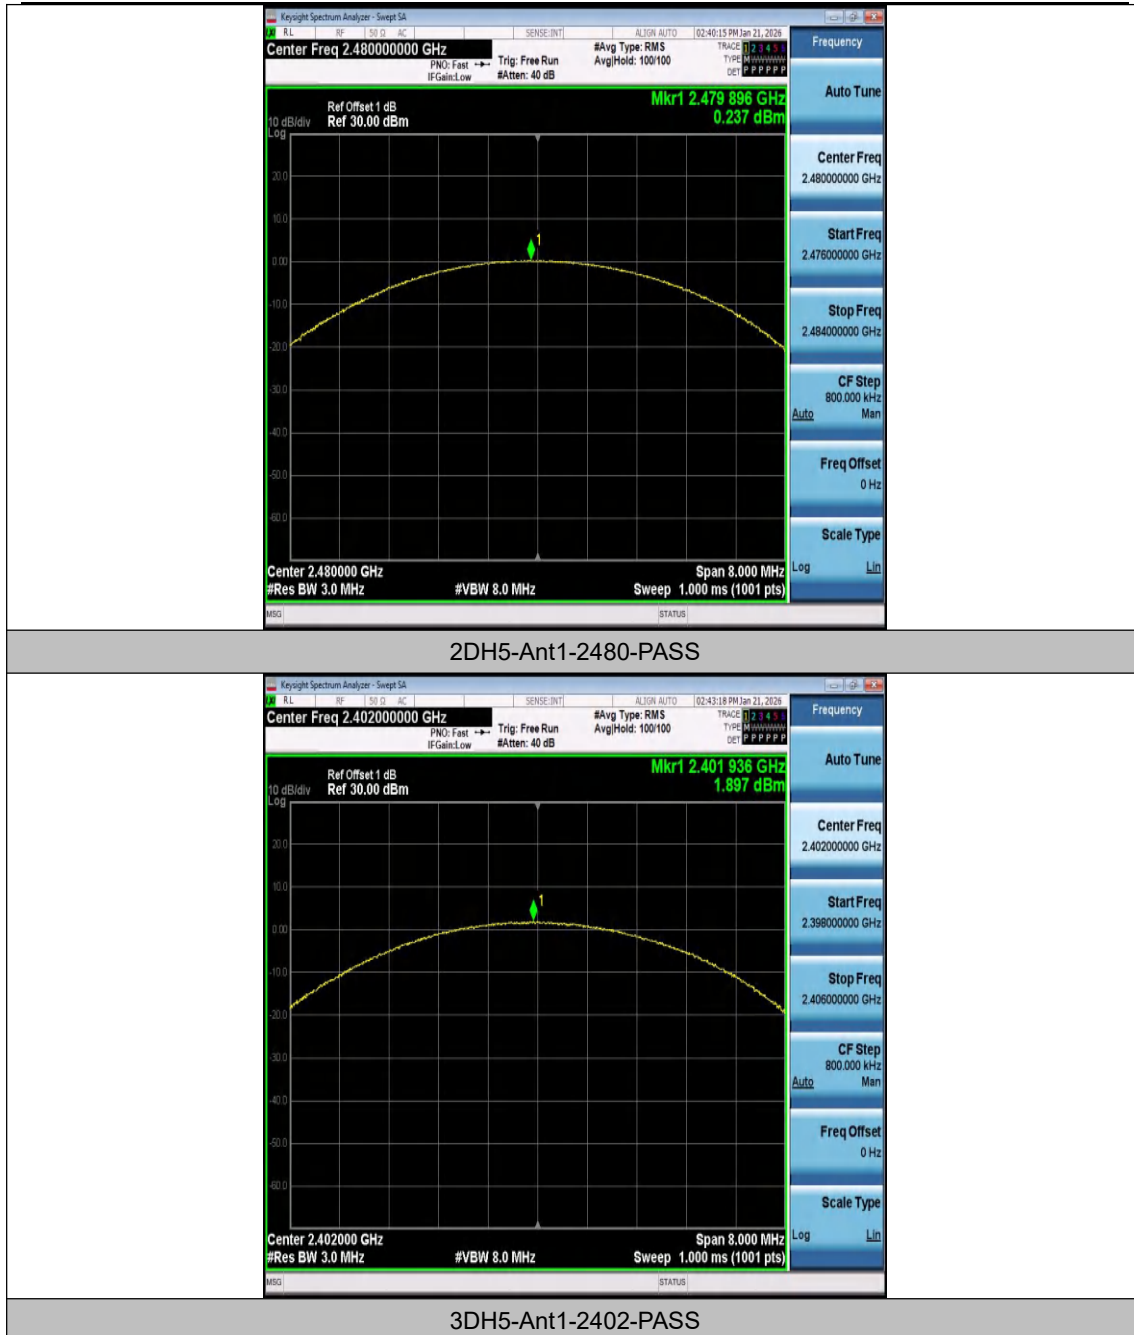

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

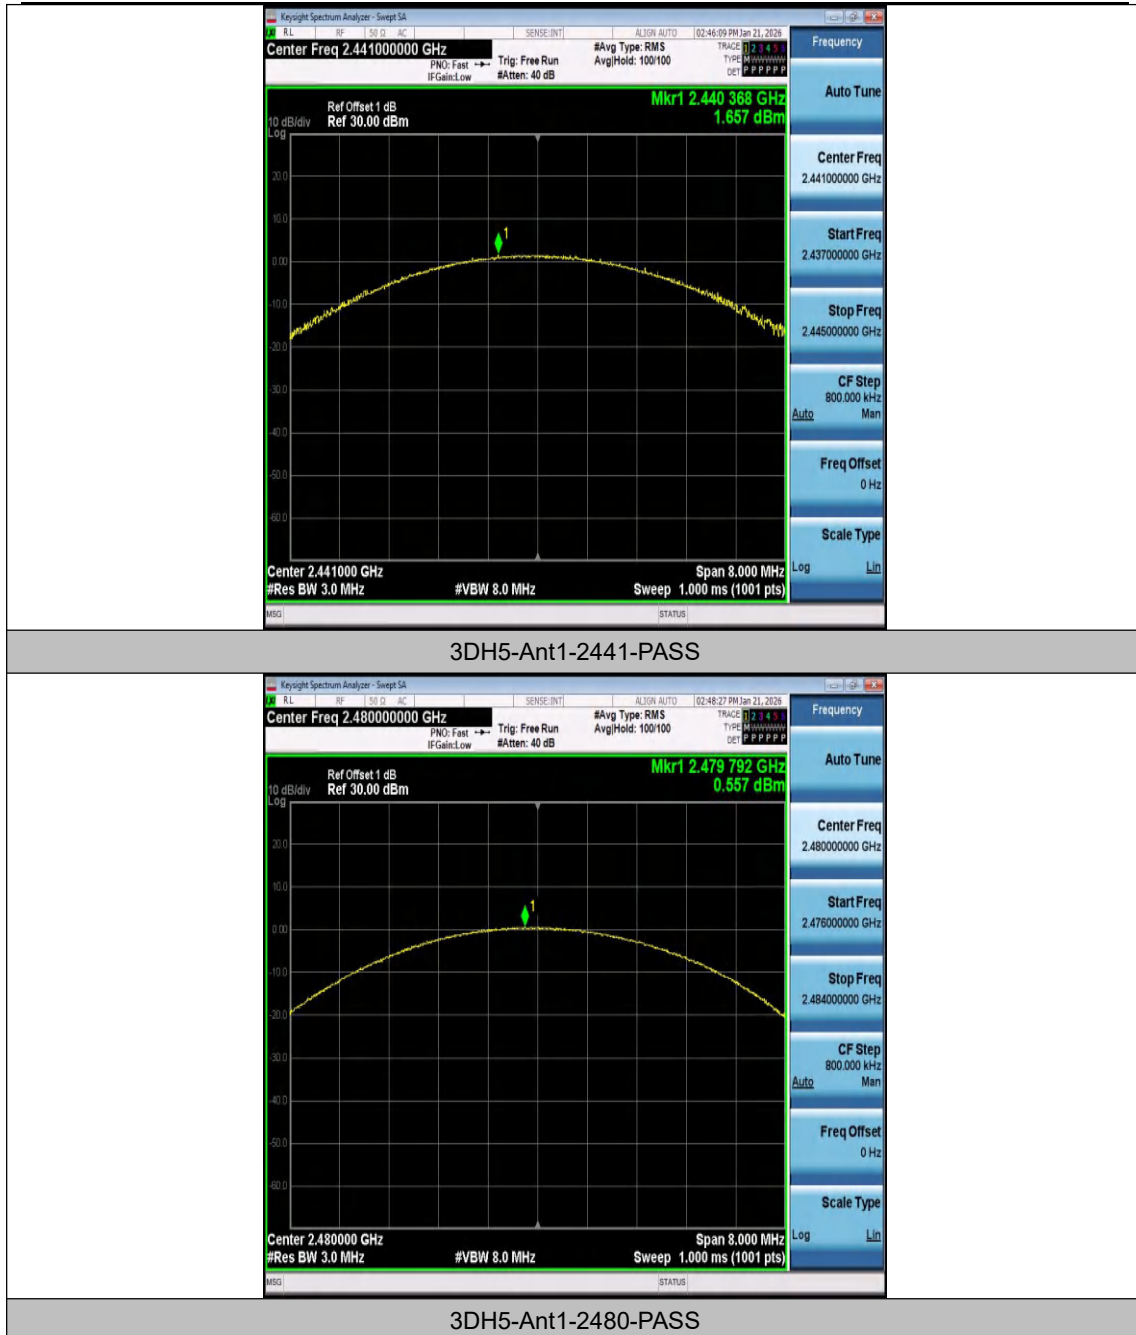

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Carrier frequency separation


Test Result

Test Mode	Antenna	Frequency [MHz]	Result [MHz]	Limit[MHz]	Verdict
DH5	Ant1	Hop	1.004	≥ 0.676	PASS
2DH5	Ant1	Hop	0.996	≥ 0.878	PASS
3DH5	Ant1	Hop	1.152	≥ 0.874	PASS

Note: For conducted power less than 0.125 W(20.97 dBm), the limit can be set using hopping channel carrier frequencies that are separated by 25 kHz or two thirds of the 20 dB bandwidth of the hopping channel, whichever is greater.

Test Graphs



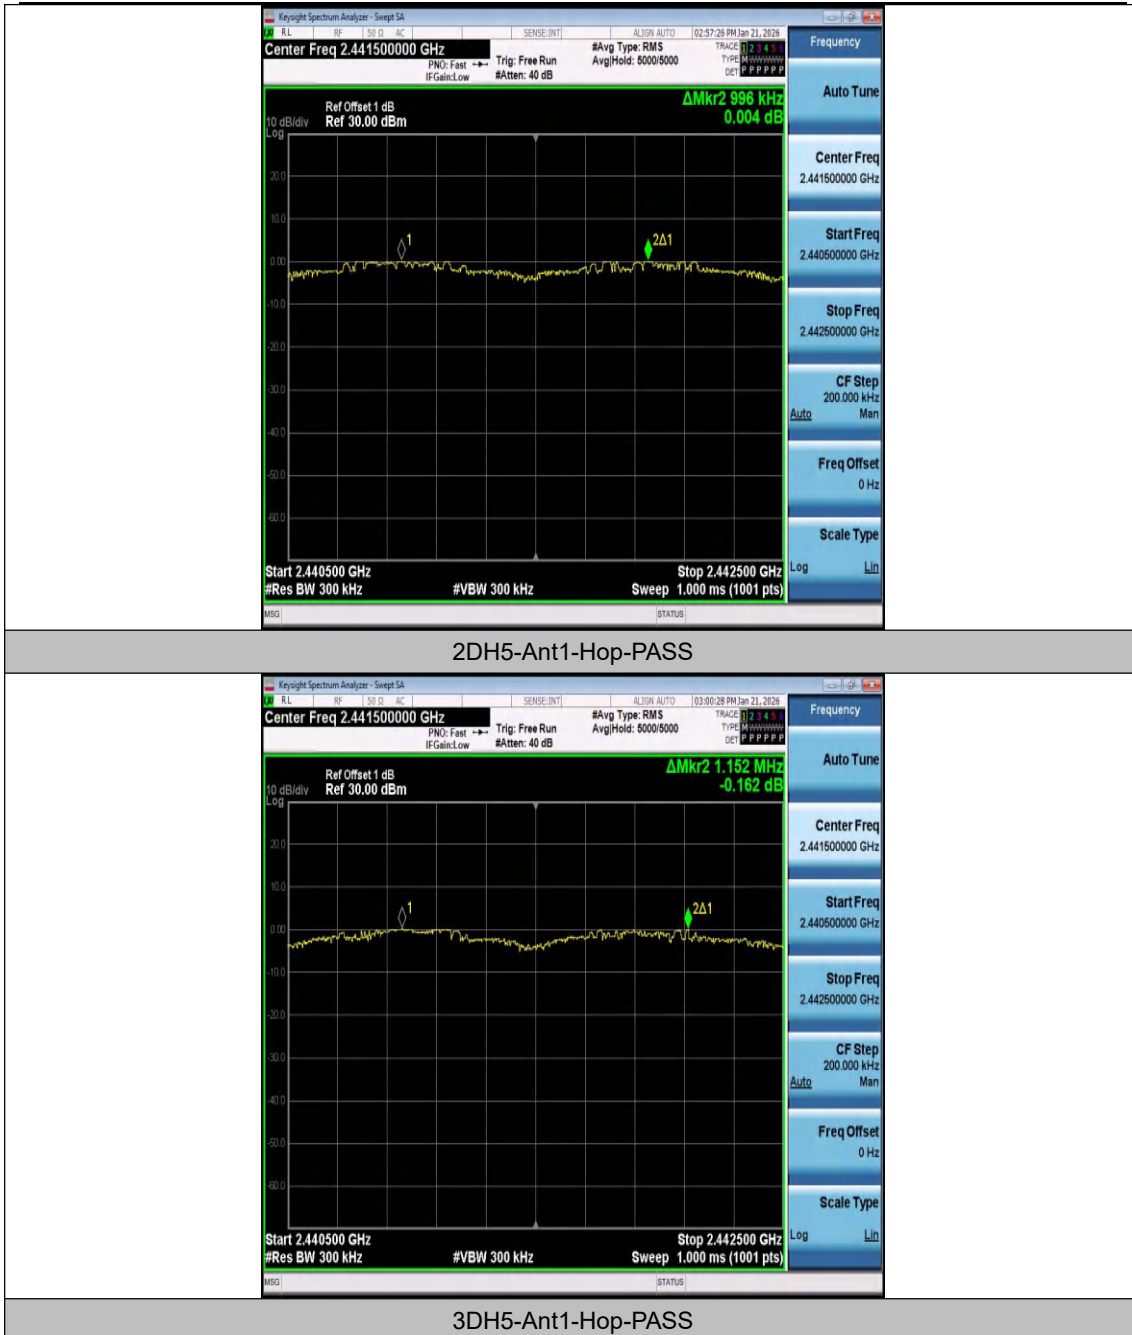

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Dwell Time

Test Result

Test Mode	Antenna	Frequency [MHz]	Burst Width [ms]	Total Hops [Num]	Result [s]	Limit [s]	Verdict
DH5	Ant1	Hop	2.885	96	0.277	≤0.4	PASS
2DH5	Ant1	Hop	2.891	113	0.327	≤0.4	PASS
3DH5	Ant1	Hop	2.892	109	0.315	≤0.4	PASS


Test Graphs

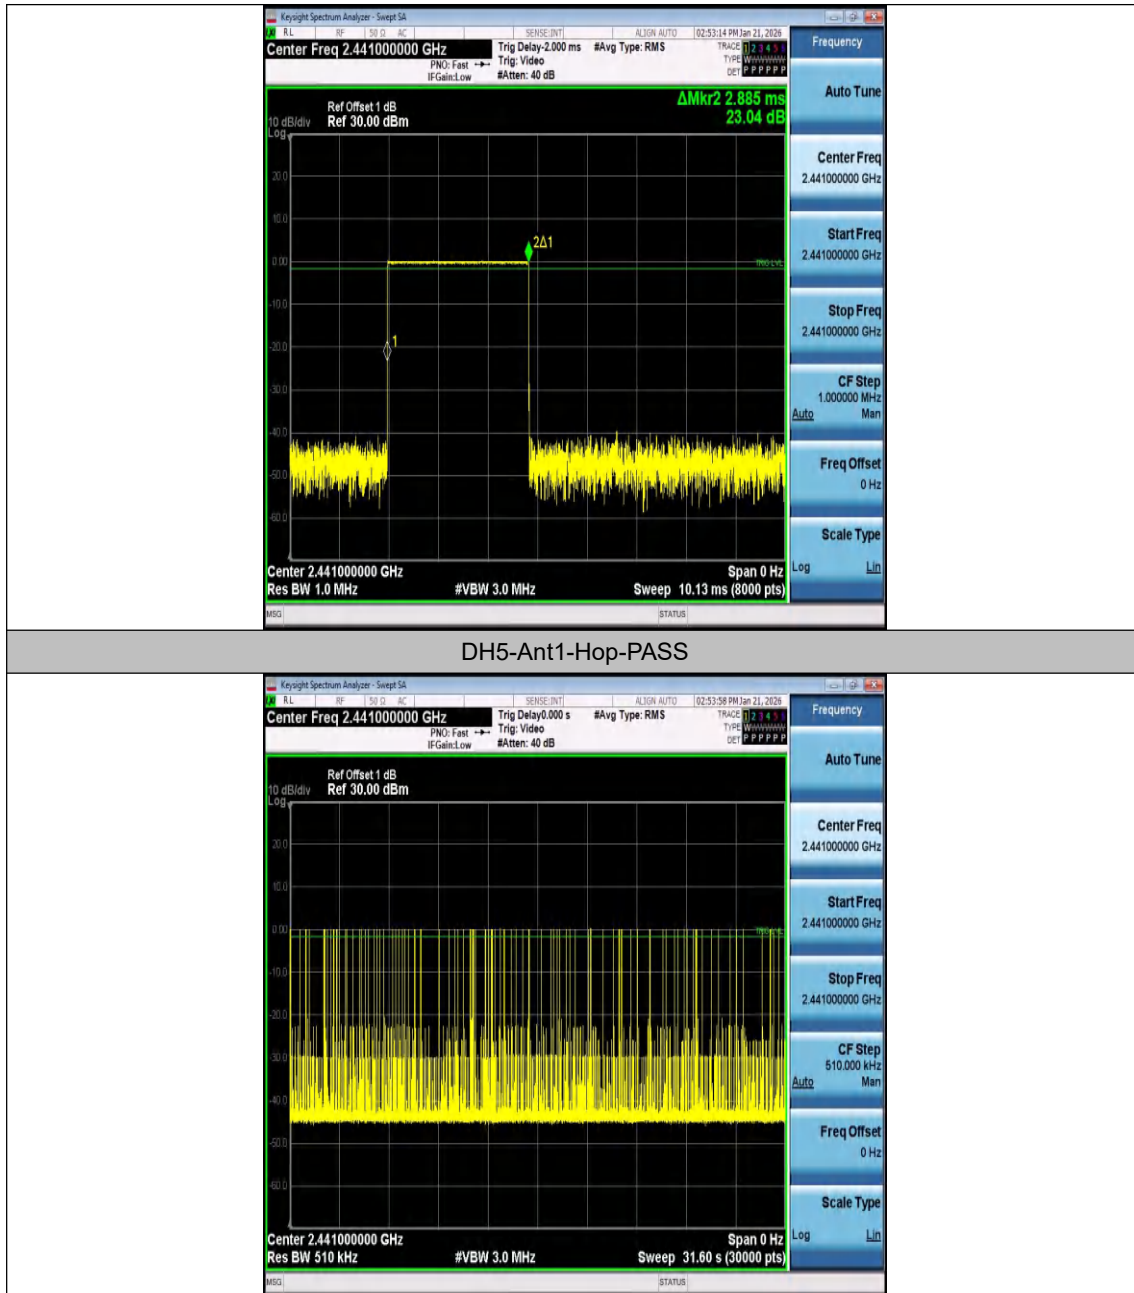

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

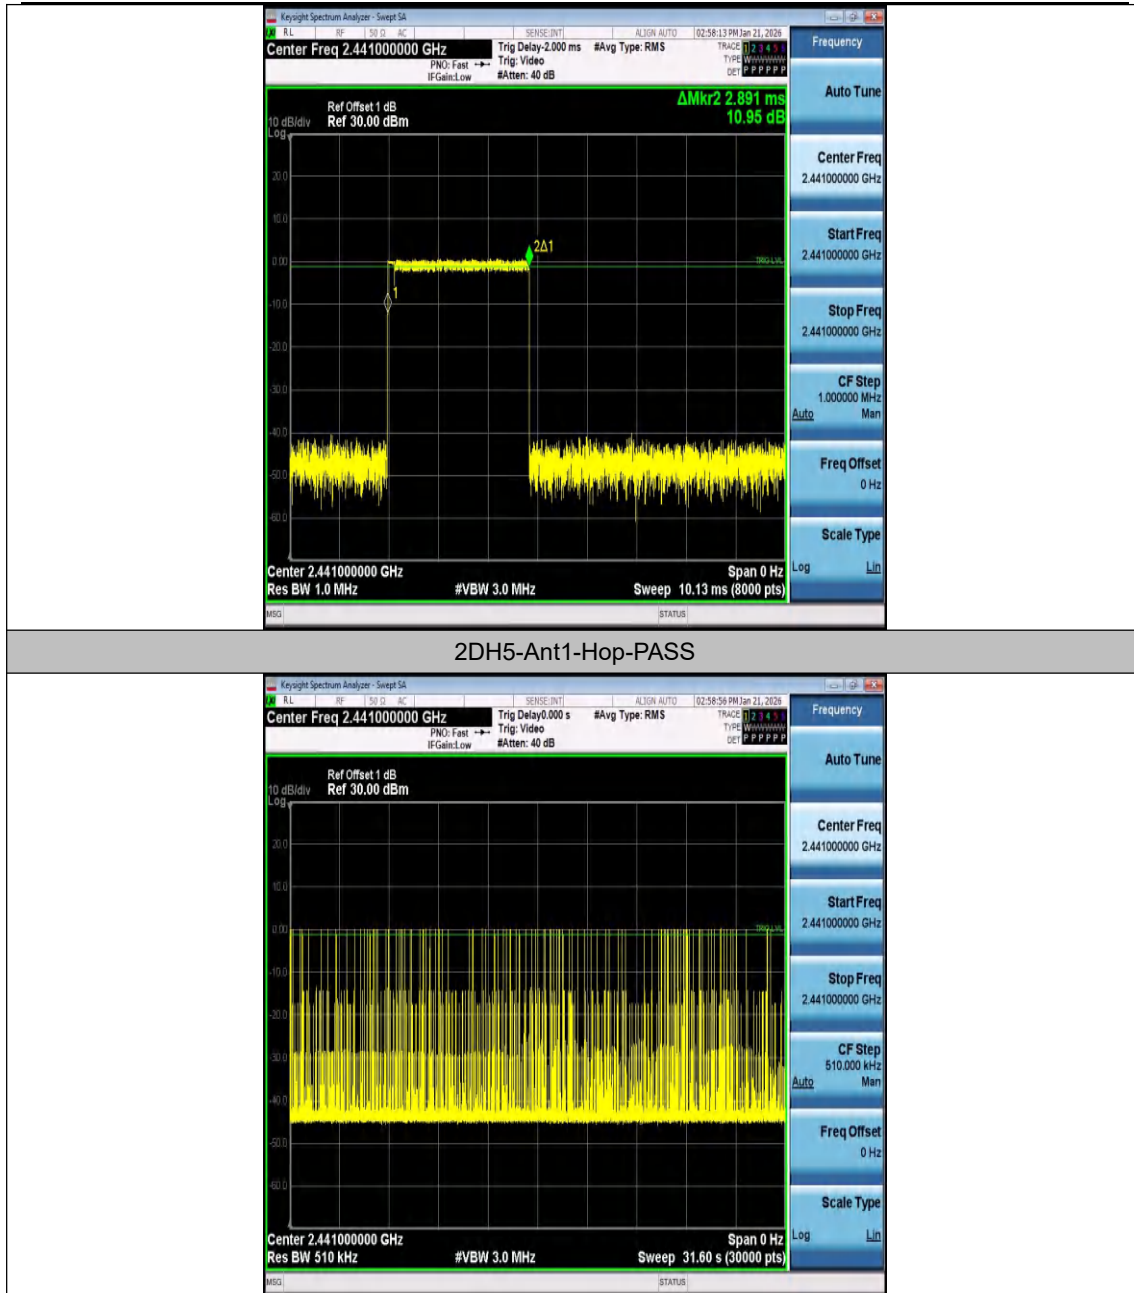

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

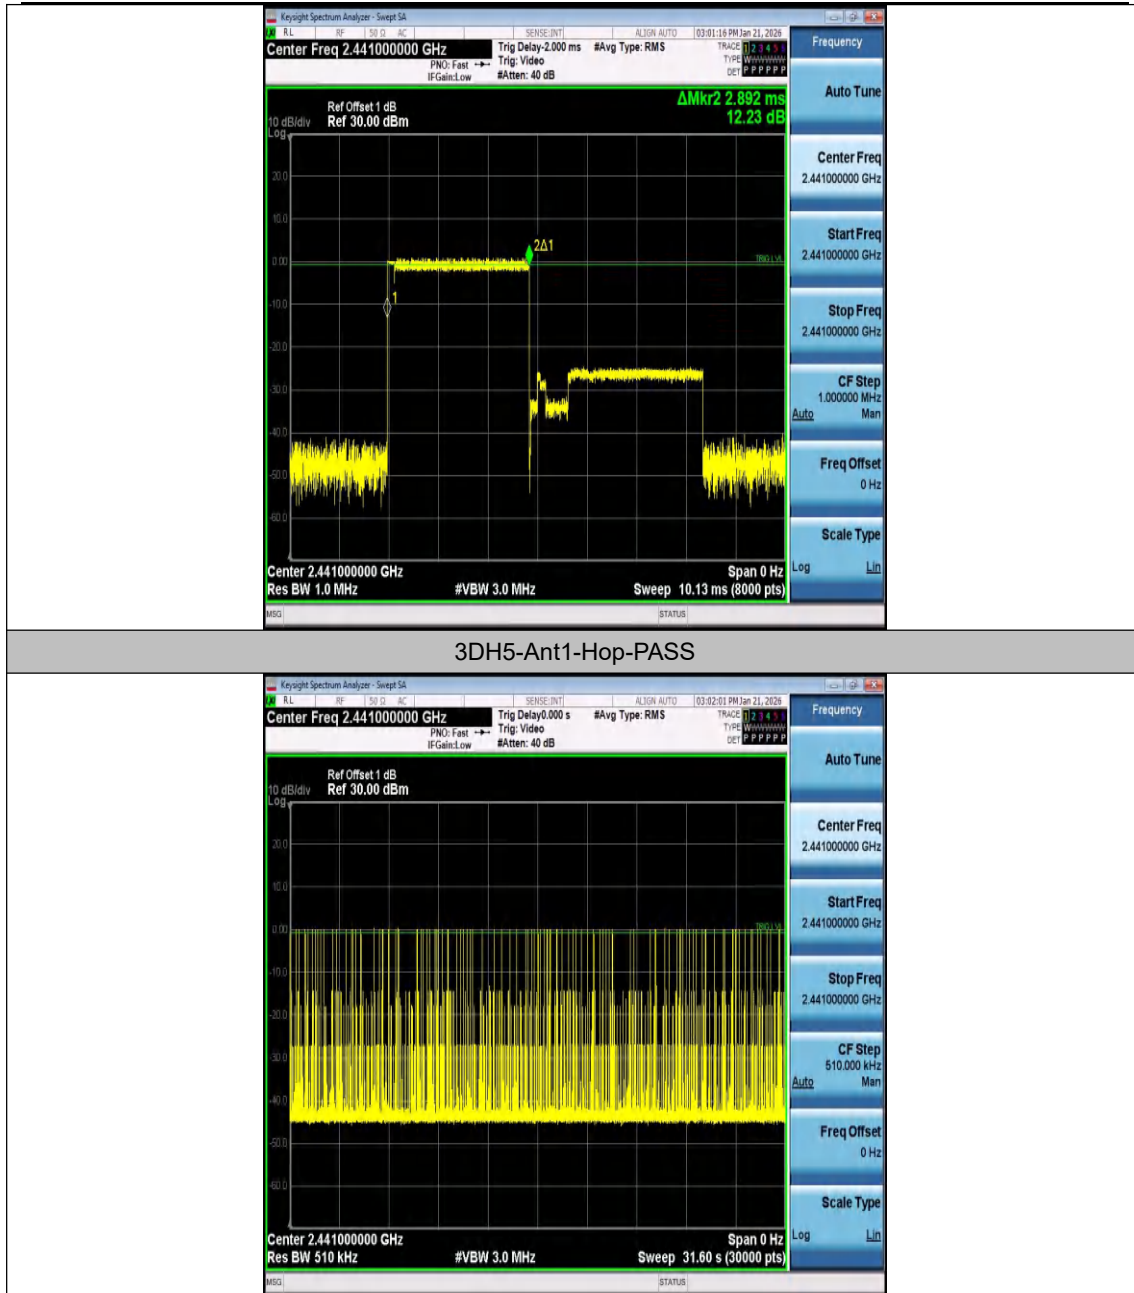

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix F: Number of Hopping Channel

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [Num]	Limit [Num]	Verdict
DH5	Ant1	Hop	79	≥15	PASS
2DH5	Ant1	Hop	79	≥15	PASS
3DH5	Ant1	Hop	79	≥15	PASS

Test Graphs

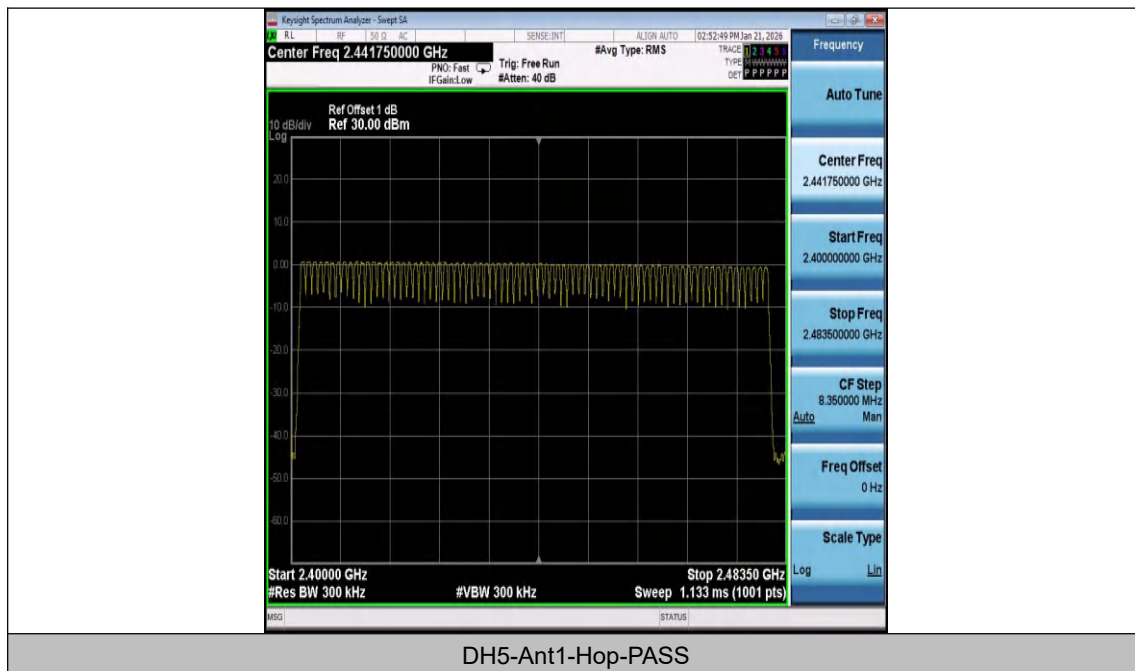

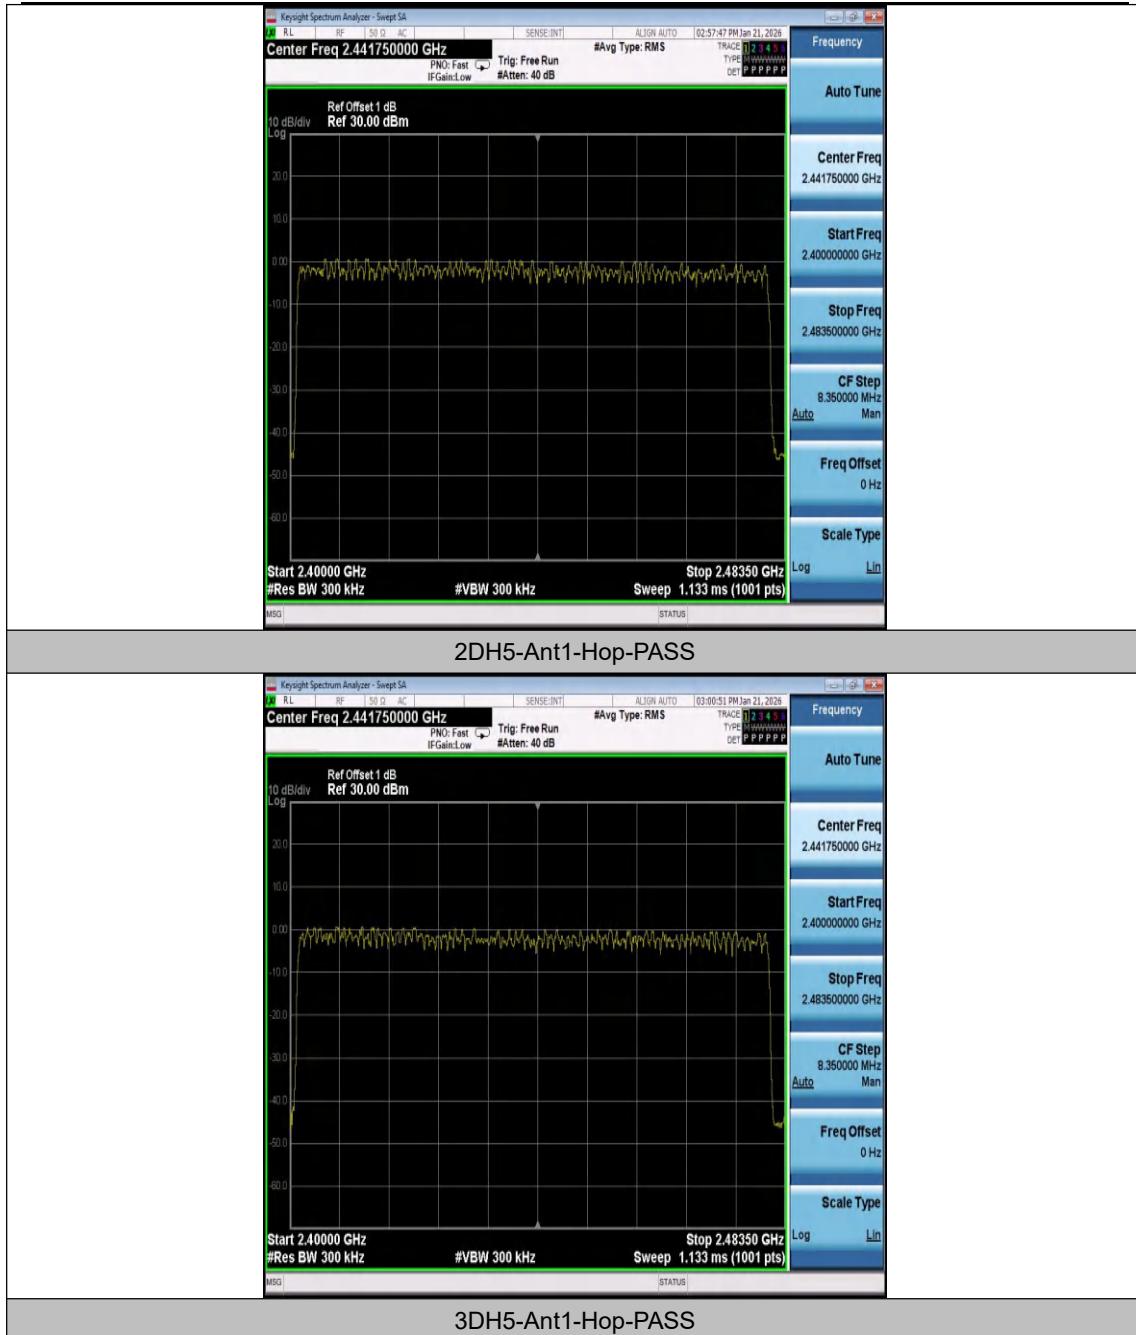


Appendix G: Conducted Band edge

Test Result

Test Mode	Antenna	Ch. Name	Frequency [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	Low	2402	0.65	-48.07	≤-19.35	PASS
DH5	Ant1	High	2480	-0.83	-56.04	≤-20.83	PASS
DH5	Ant1	Low	Hop_2402	-0.09	-55.08	≤-20.09	PASS
DH5	Ant1	High	Hop_2480	-1.39	-55.22	≤-21.39	PASS
2DH5	Ant1	Low	2402	0.27	-48.97	≤-19.73	PASS
2DH5	Ant1	High	2480	-0.81	-55.77	≤-20.81	PASS
2DH5	Ant1	Low	Hop_2402	-0.84	-56.4	≤-20.84	PASS
2DH5	Ant1	High	Hop_2480	-3.22	-50.34	≤-23.22	PASS
3DH5	Ant1	Low	2402	0.43	-48.27	≤-19.58	PASS
3DH5	Ant1	High	2480	-1.22	-55.9	≤-21.22	PASS
3DH5	Ant1	Low	Hop_2402	0.30	-56.64	≤-19.7	PASS
3DH5	Ant1	High	Hop_2480	-2.12	-55.21	≤-22.12	PASS


Test Graphs

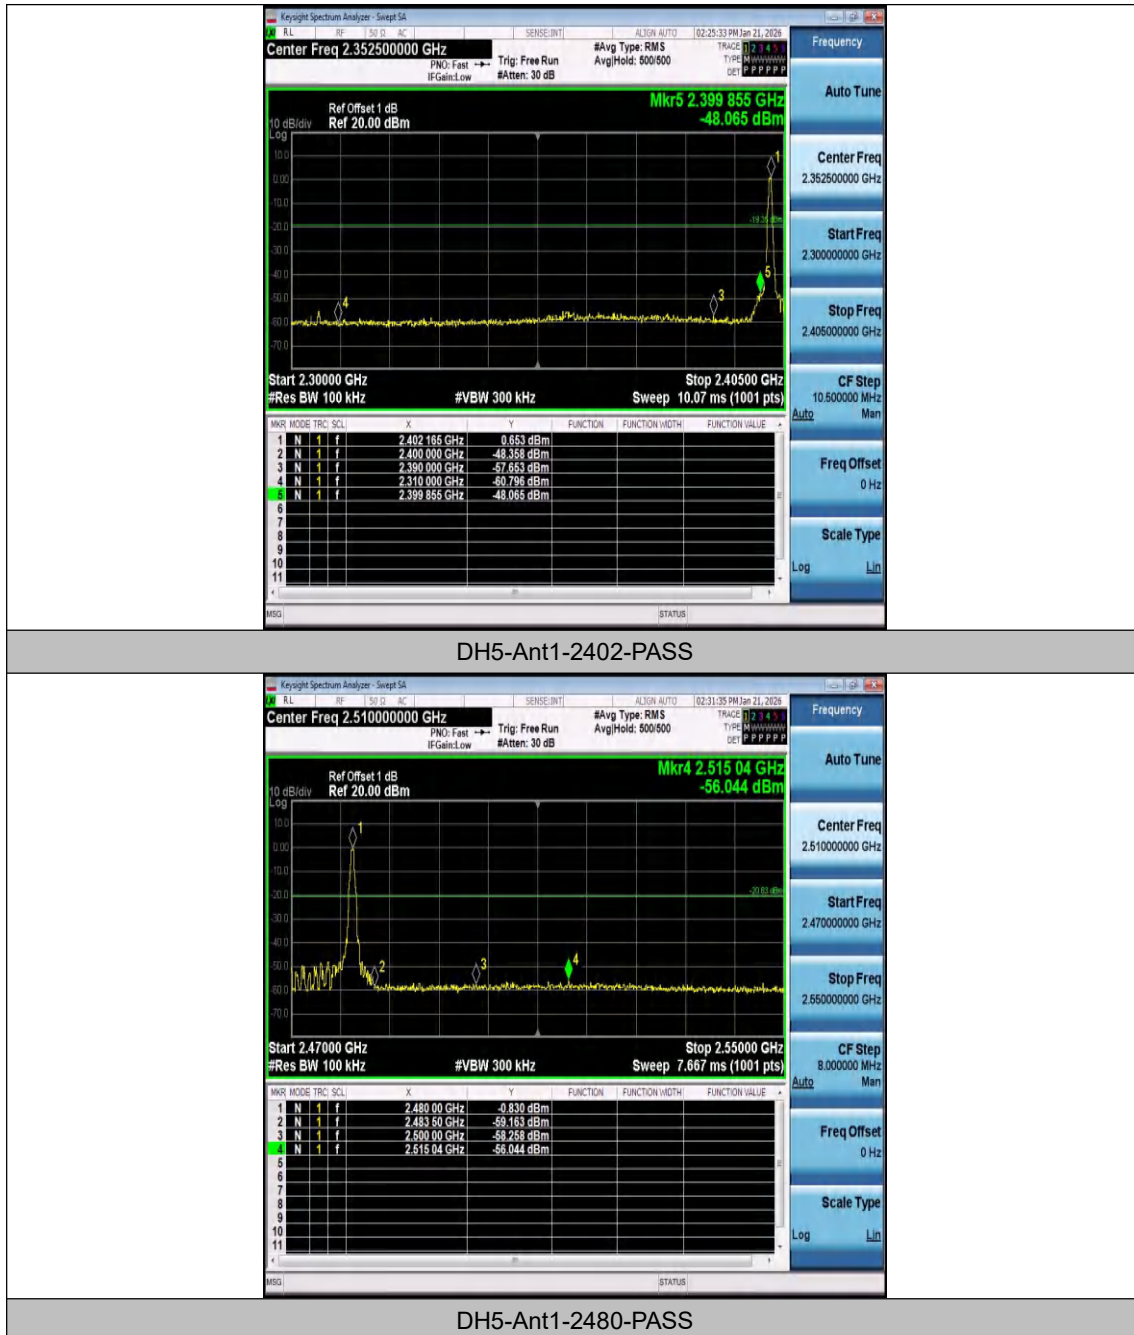


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

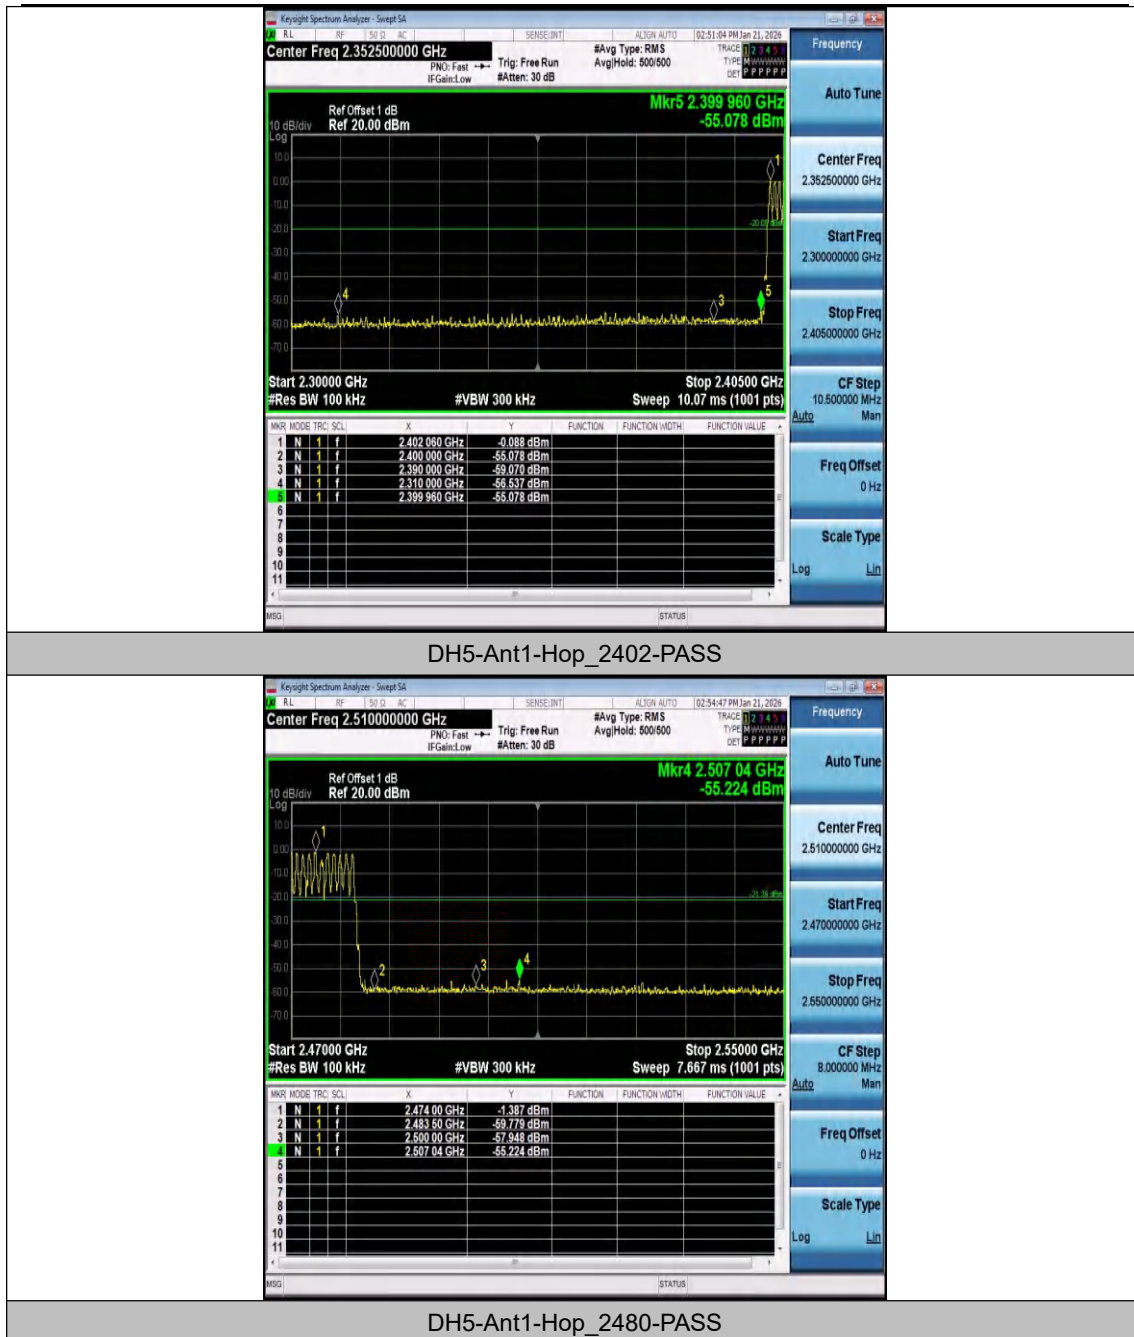


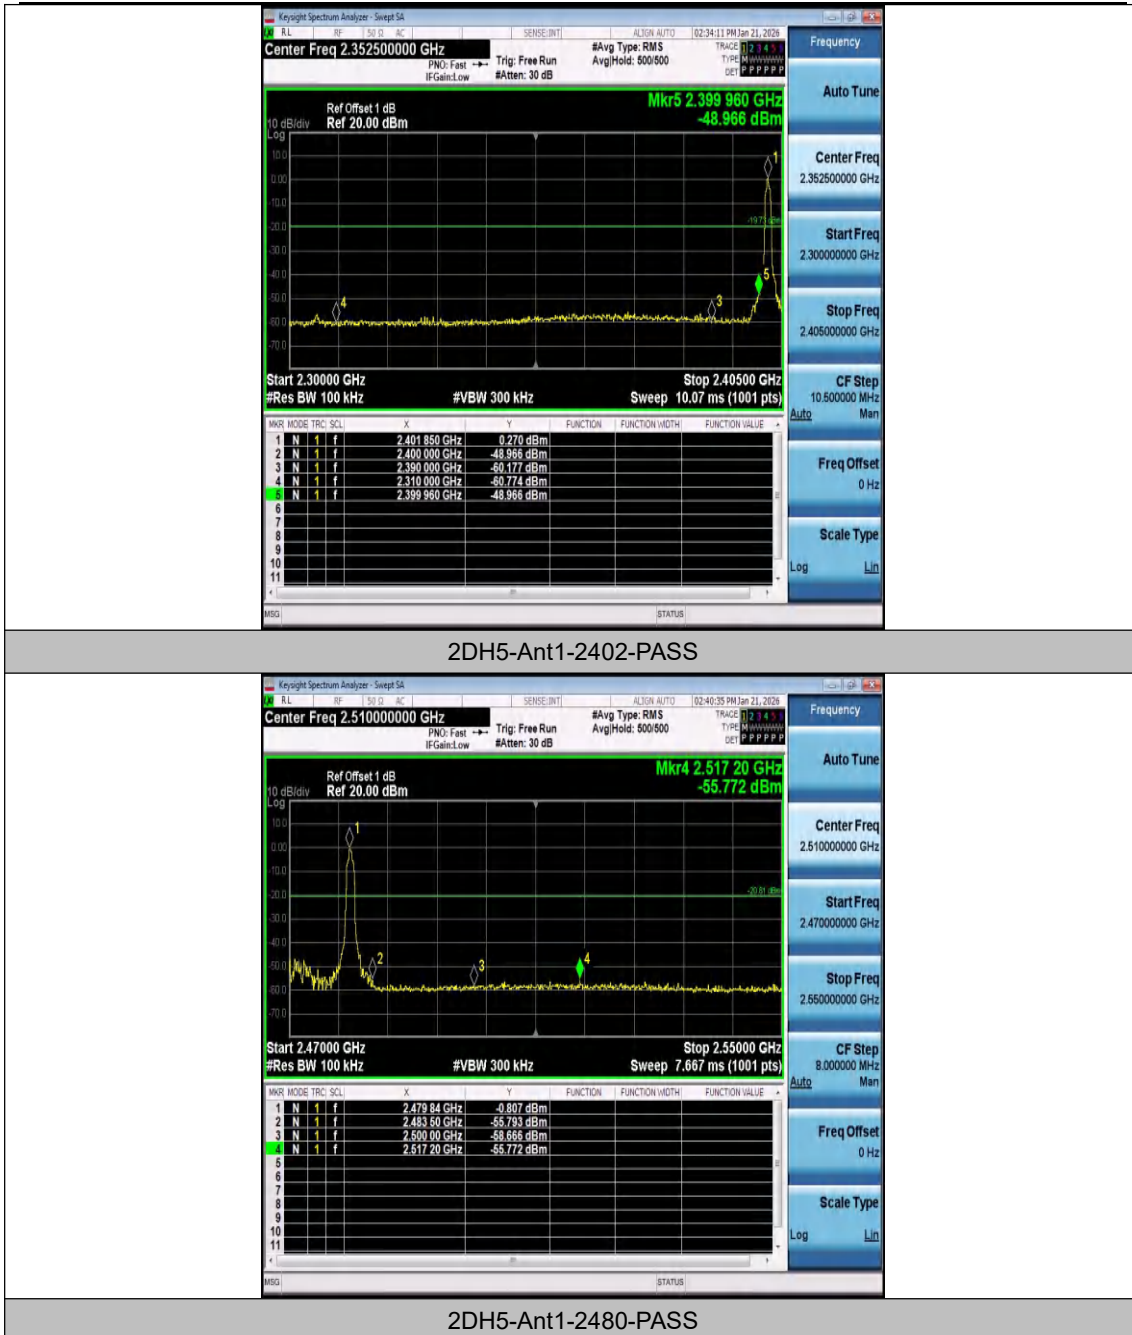



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

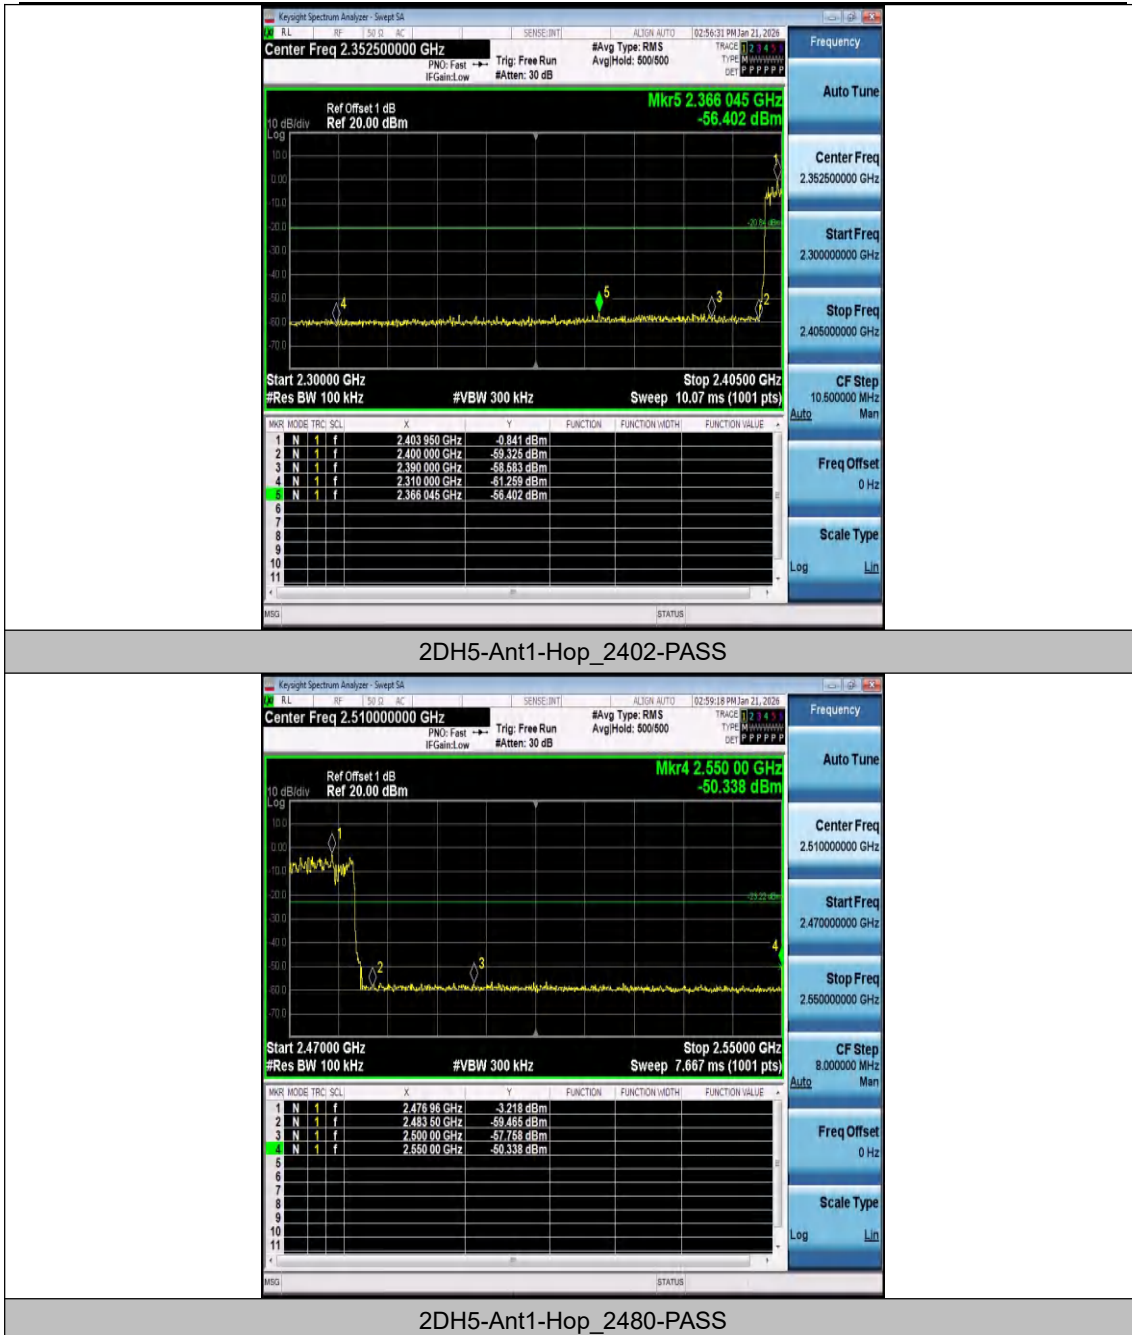

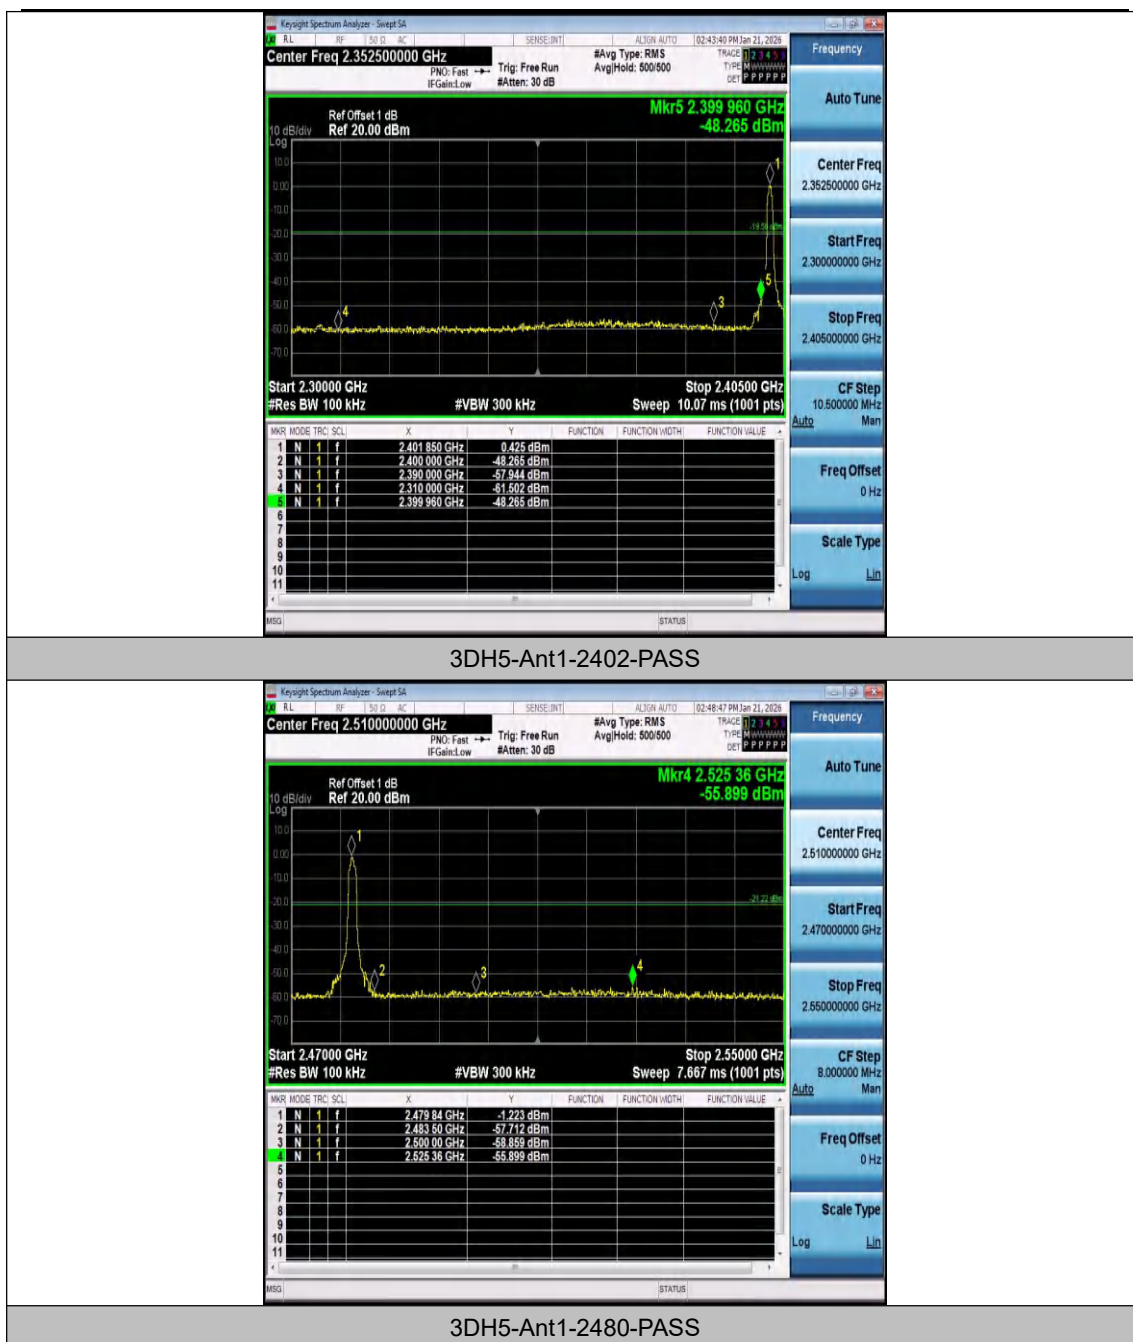

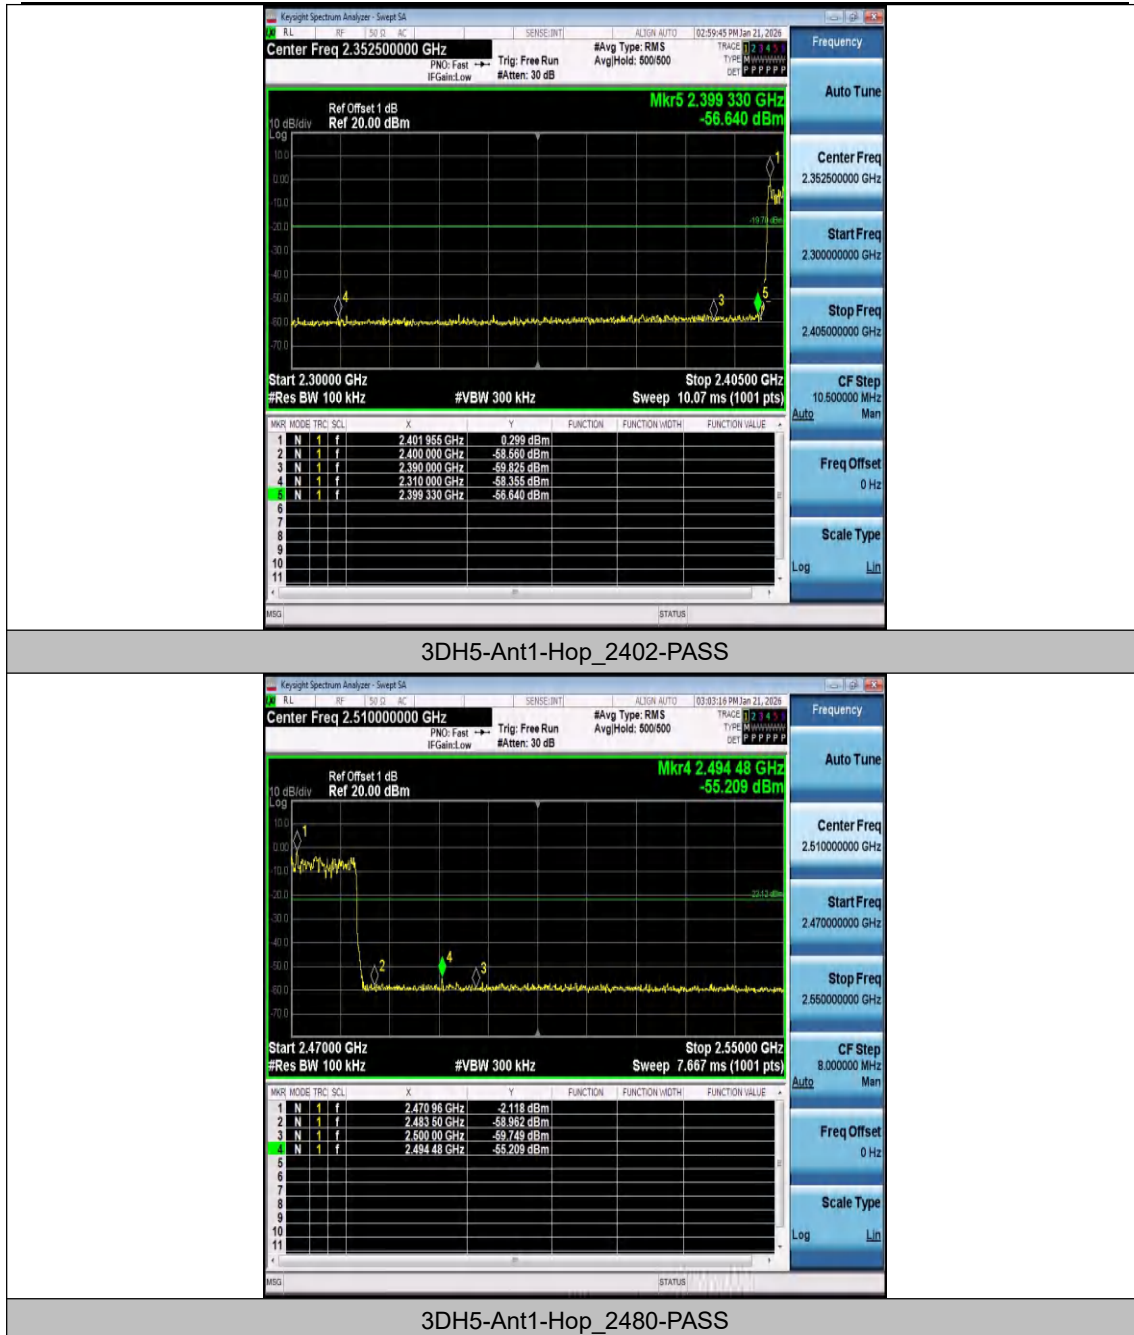


Appendix H: Conducted Spurious Emission

Test Result

Test Mode	Antenna	Frequency[MHz]	Freq. Range [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	2402	0~Reference	0.23	0.23	---	PASS
DH5	Ant1	2402	30~1000	0.23	-57.95	≤-19.77	PASS
DH5	Ant1	2402	1000~26500	0.23	-45.42	≤-19.77	PASS
DH5	Ant1	2441	0~Reference	0.12	0.12	---	PASS
DH5	Ant1	2441	30~1000	0.12	-58.05	≤-19.88	PASS
DH5	Ant1	2441	1000~26500	0.12	-48.51	≤-19.88	PASS
DH5	Ant1	2480	0~Reference	-0.76	-0.76	---	PASS
DH5	Ant1	2480	30~1000	-0.76	-59.34	≤-20.76	PASS
DH5	Ant1	2480	1000~26500	-0.76	-41.86	≤-20.76	PASS
2DH5	Ant1	2402	0~Reference	0.51	0.51	---	PASS
2DH5	Ant1	2402	30~1000	0.51	-58.4	≤-19.49	PASS
2DH5	Ant1	2402	1000~26500	0.51	-41.98	≤-19.49	PASS
2DH5	Ant1	2441	0~Reference	-1.11	-1.11	---	PASS
2DH5	Ant1	2441	30~1000	-1.11	-59.33	≤-21.11	PASS
2DH5	Ant1	2441	1000~26500	-1.11	-49.07	≤-21.11	PASS
2DH5	Ant1	2480	0~Reference	-0.99	-0.99	---	PASS
2DH5	Ant1	2480	30~1000	-0.99	-58.89	≤-20.99	PASS
2DH5	Ant1	2480	1000~26500	-0.99	-48.49	≤-20.99	PASS
3DH5	Ant1	2402	0~Reference	0.28	0.28	---	PASS
3DH5	Ant1	2402	30~1000	0.28	-55.76	≤-19.72	PASS
3DH5	Ant1	2402	1000~26500	0.28	-49.01	≤-19.72	PASS
3DH5	Ant1	2441	0~Reference	0.02	0.02	---	PASS
3DH5	Ant1	2441	30~1000	0.02	-57.44	≤-19.98	PASS
3DH5	Ant1	2441	1000~26500	0.02	-42.92	≤-19.98	PASS
3DH5	Ant1	2480	0~Reference	-0.94	-0.94	---	PASS
3DH5	Ant1	2480	30~1000	-0.94	-59.29	≤-20.94	PASS
3DH5	Ant1	2480	1000~26500	-0.94	-48.75	≤-20.94	PASS

Remark: Regarding the spurious emissions from 30MHz to 26.5GHz, the cable loss have been set in the 'Input Correction' of the Spectrum Analyzer during the test.


Test Graphs

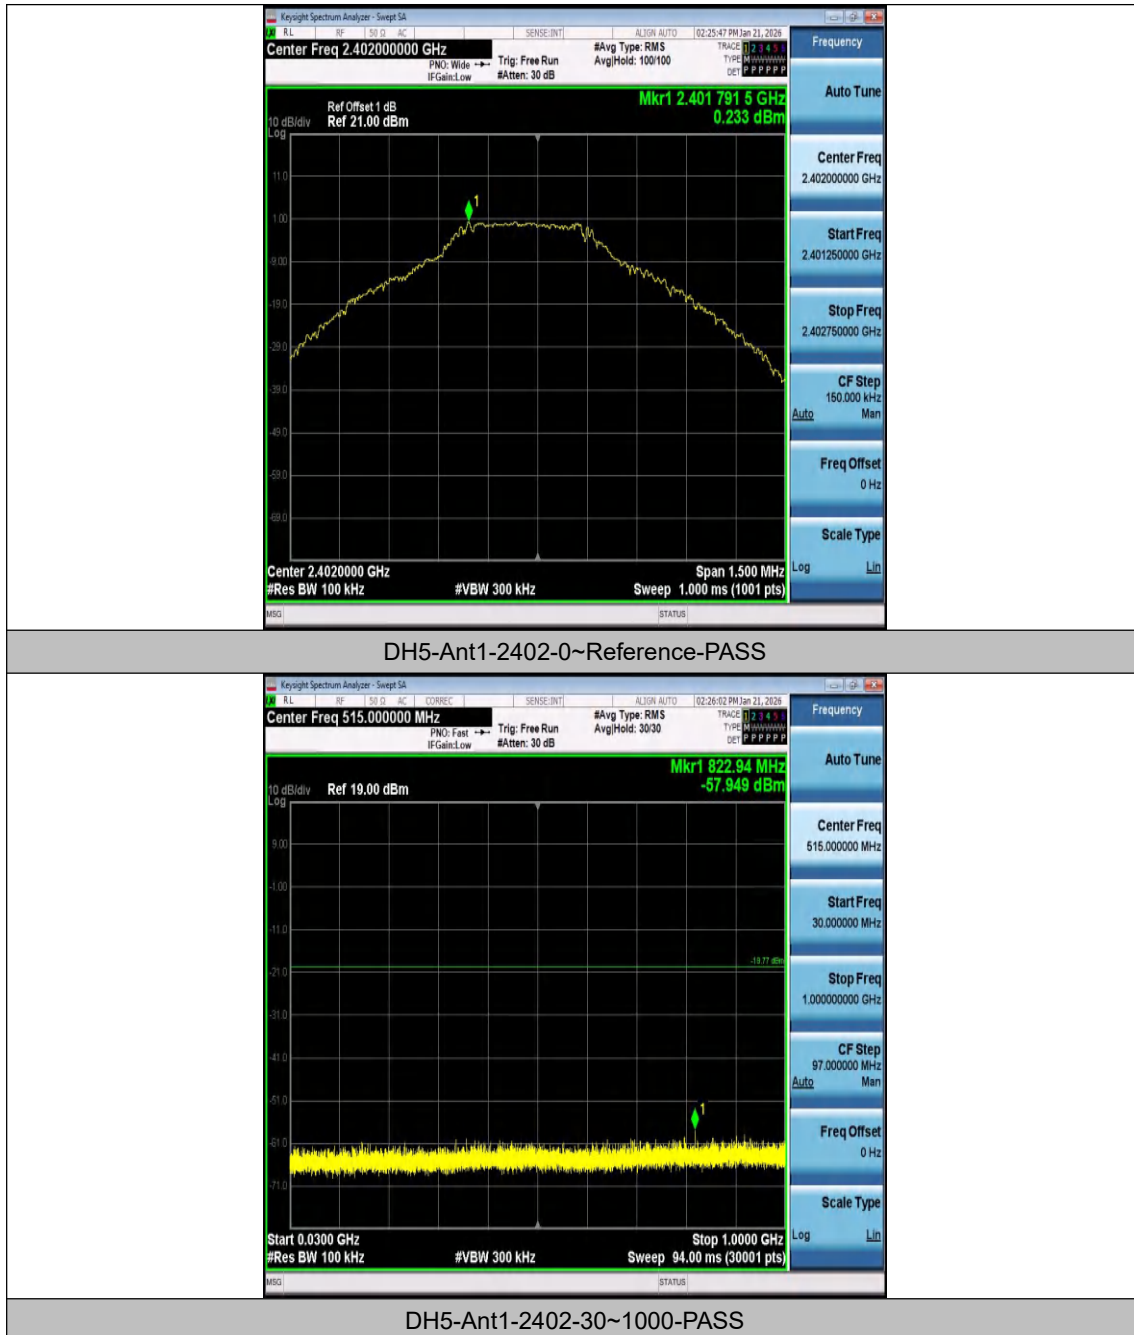

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

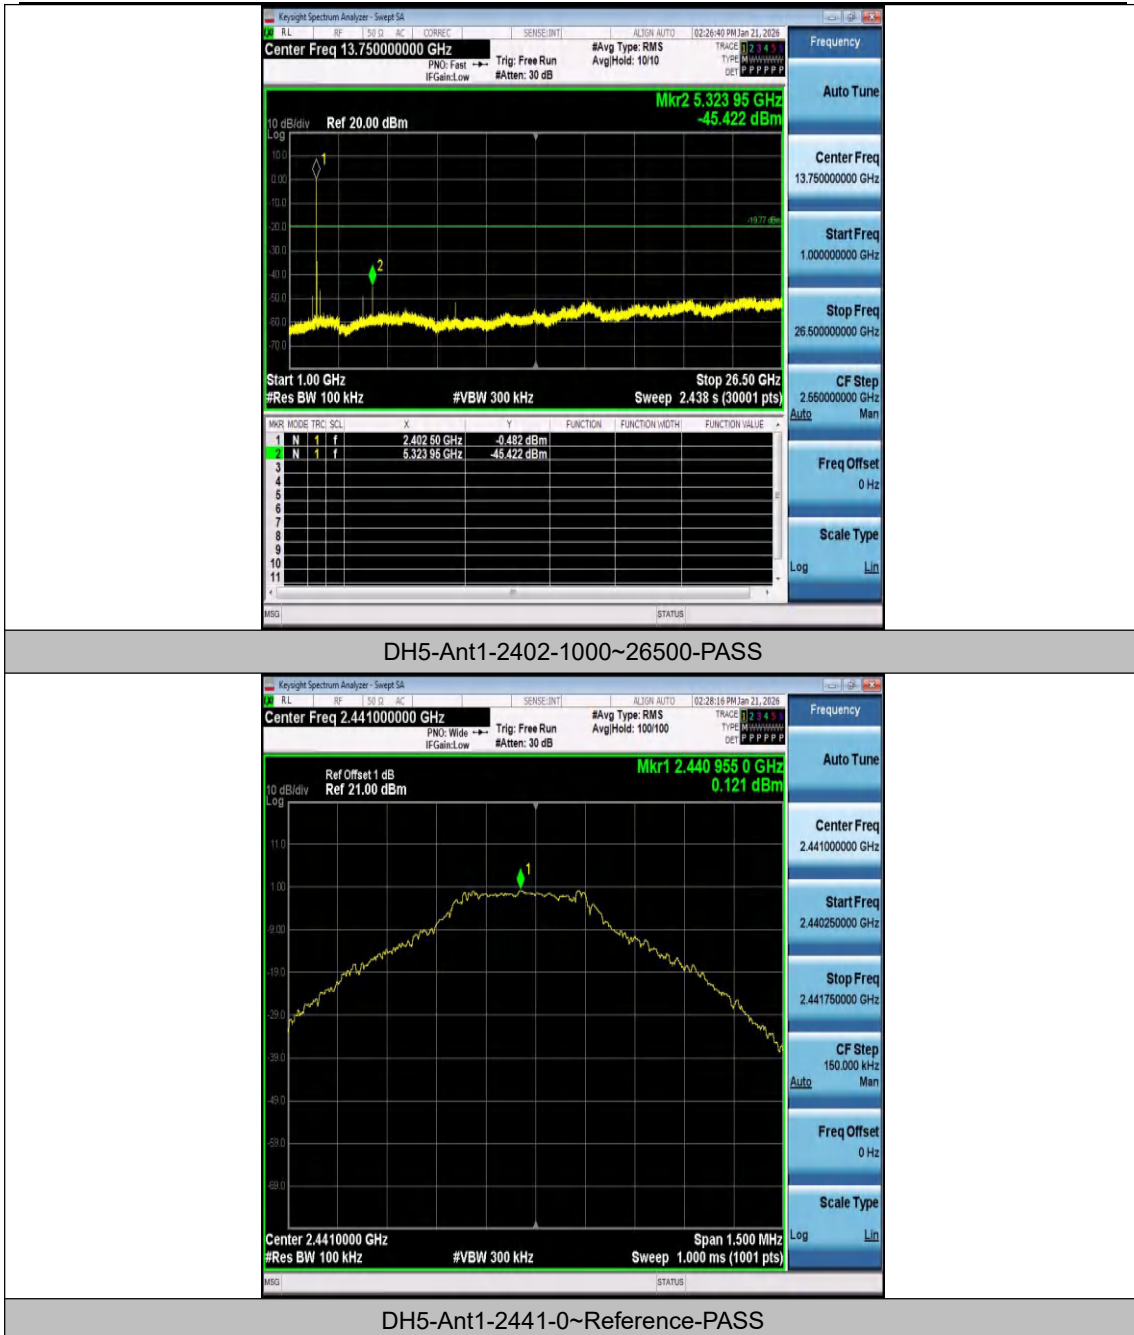

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

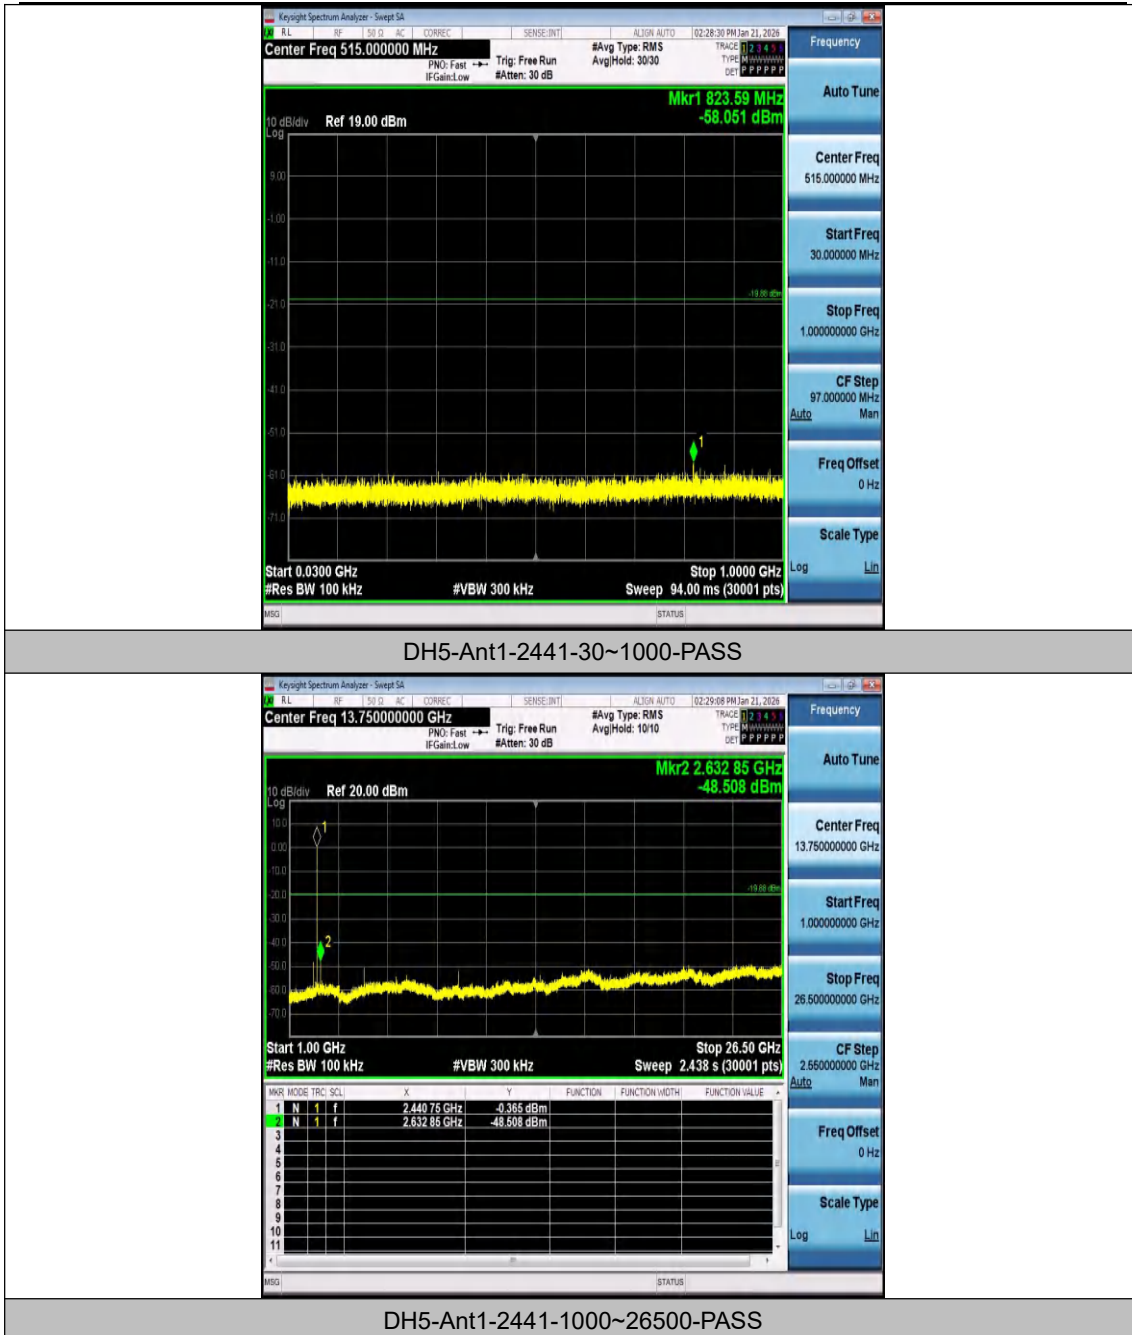

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

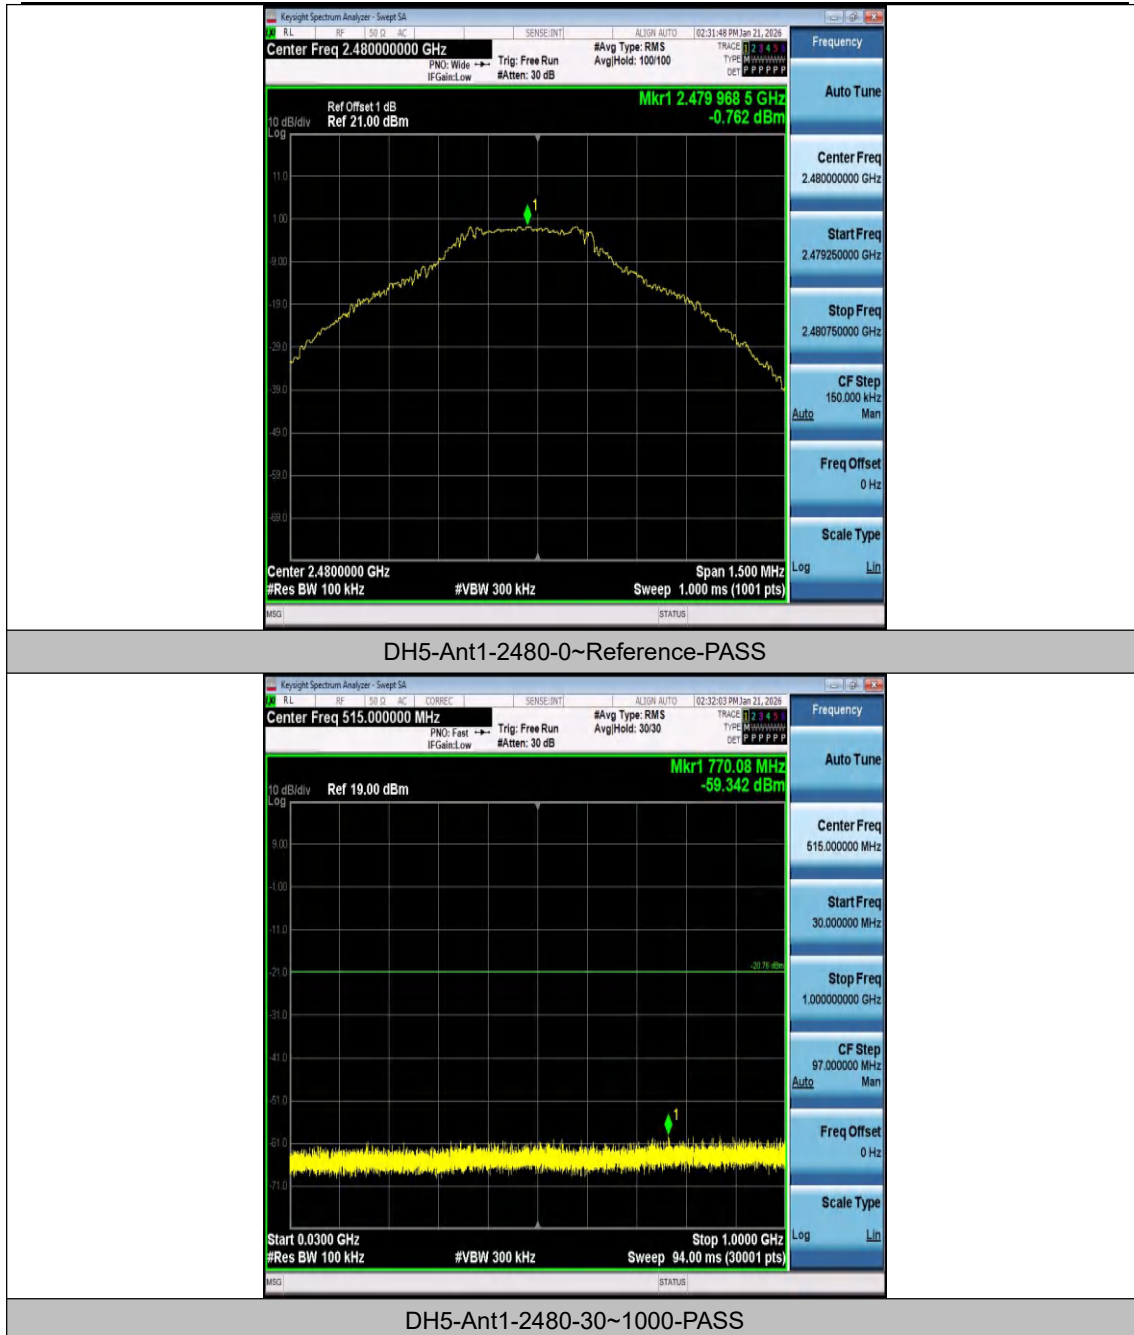


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

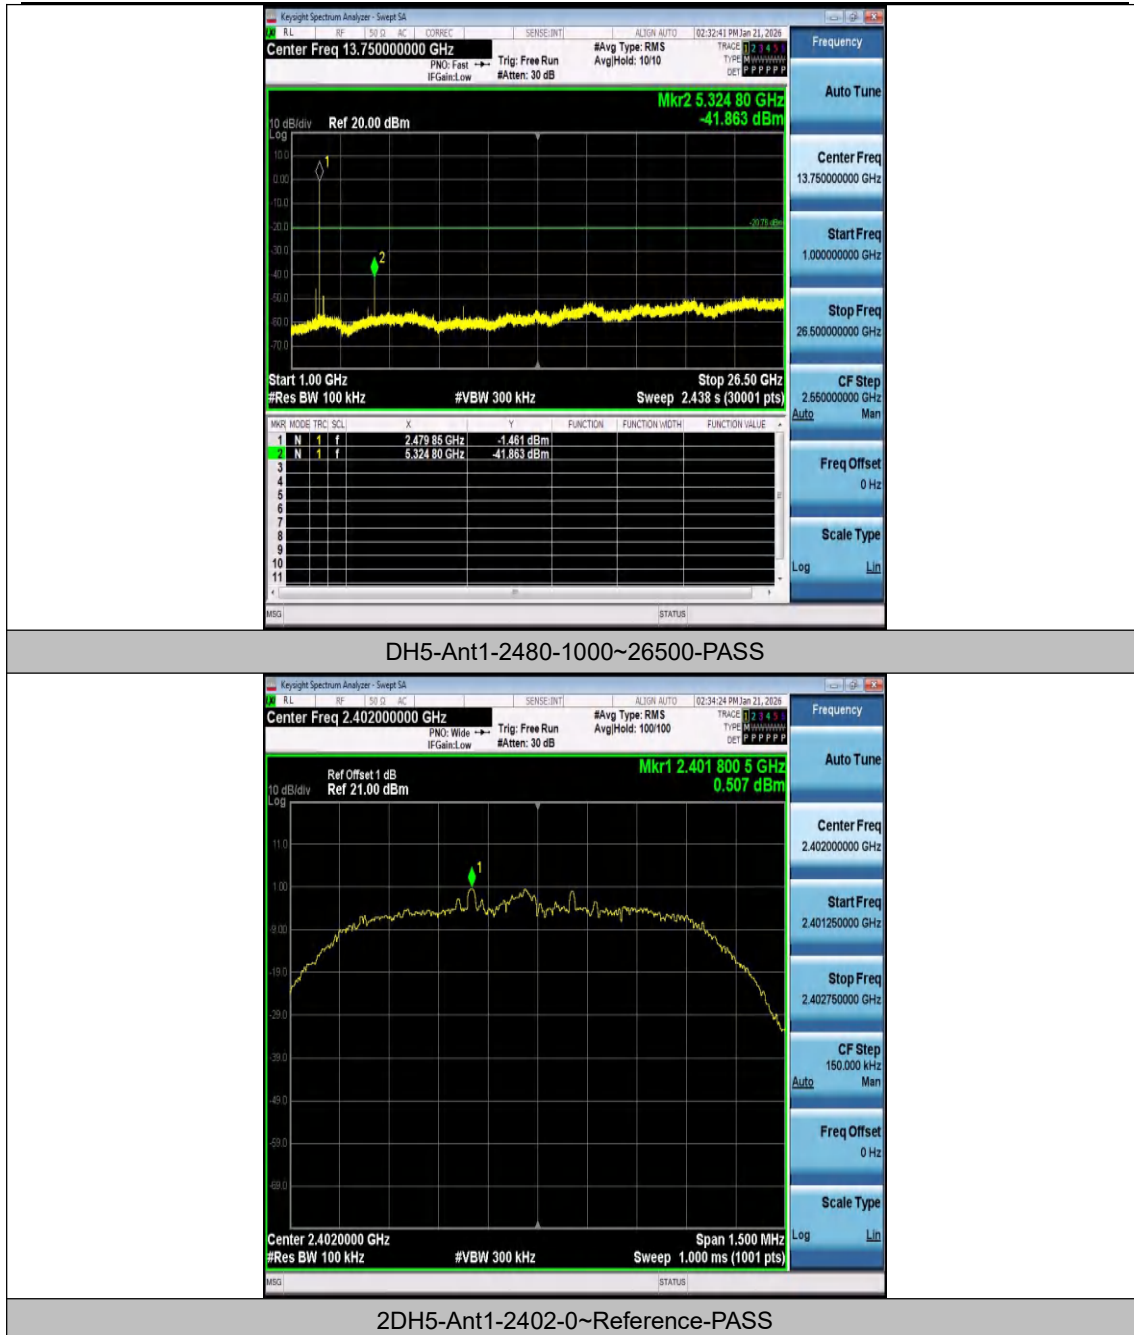


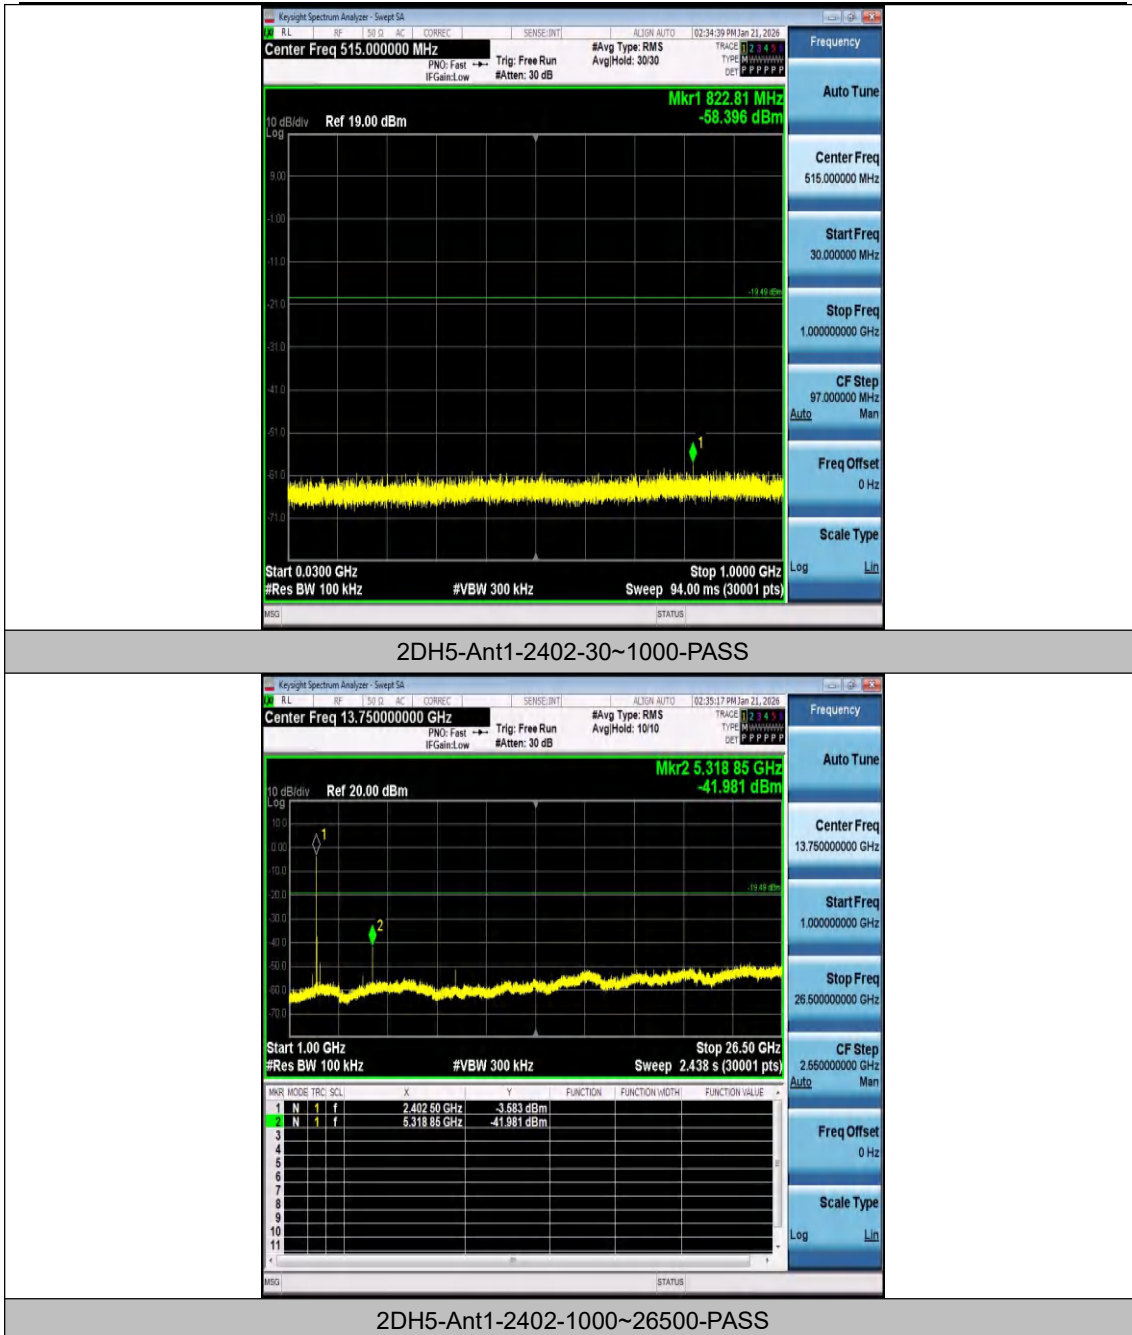

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

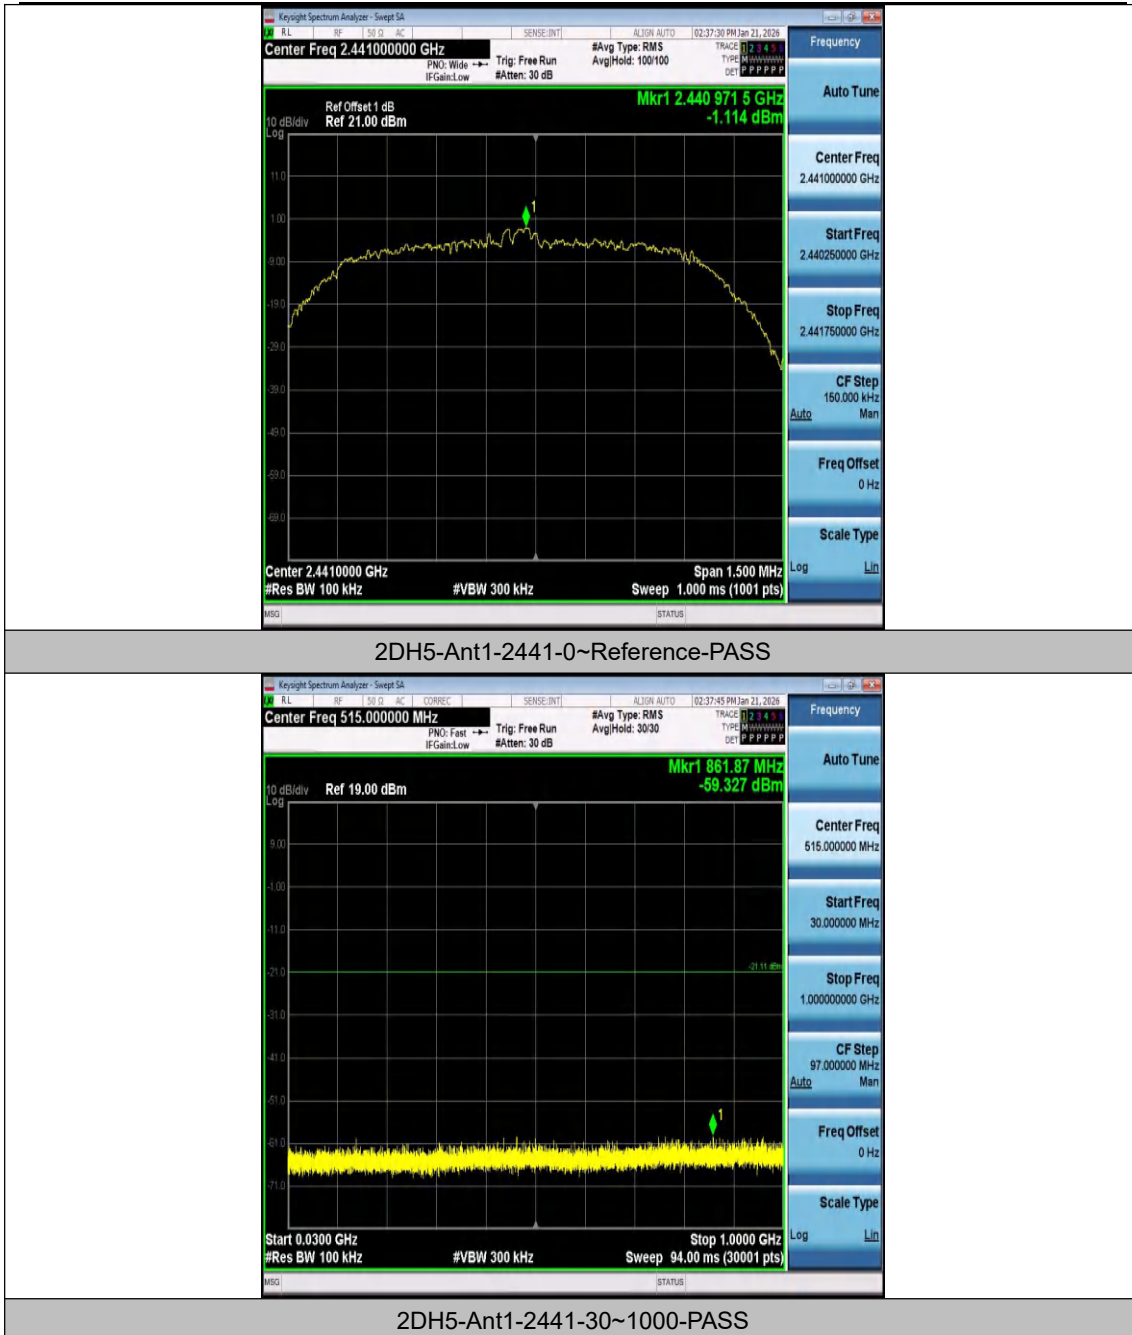

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

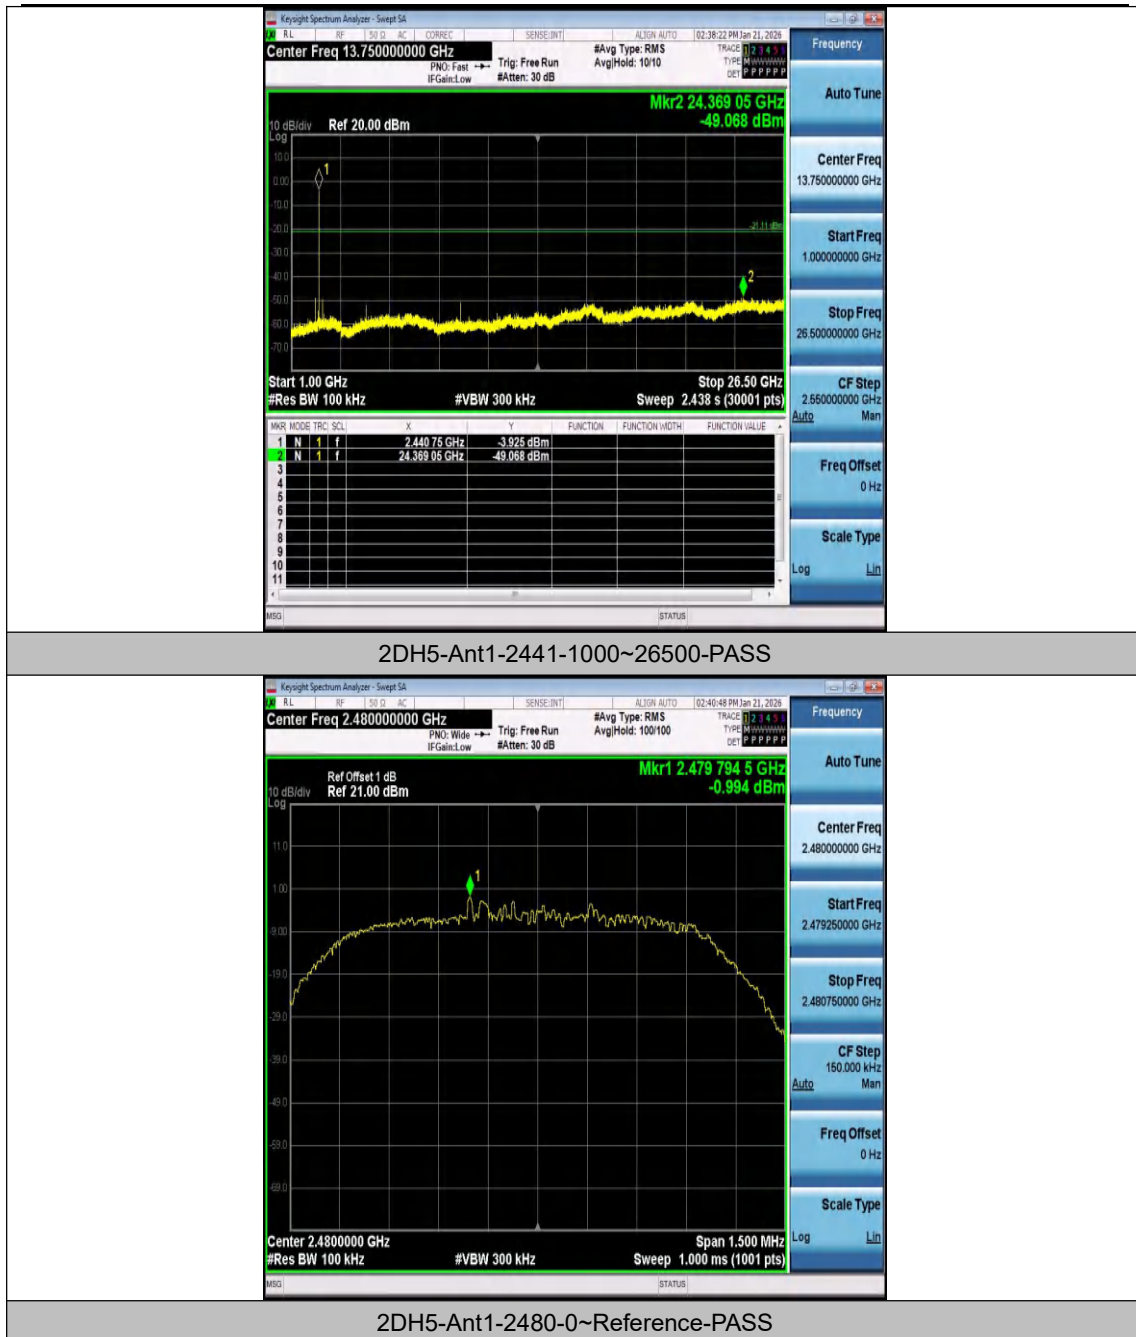

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

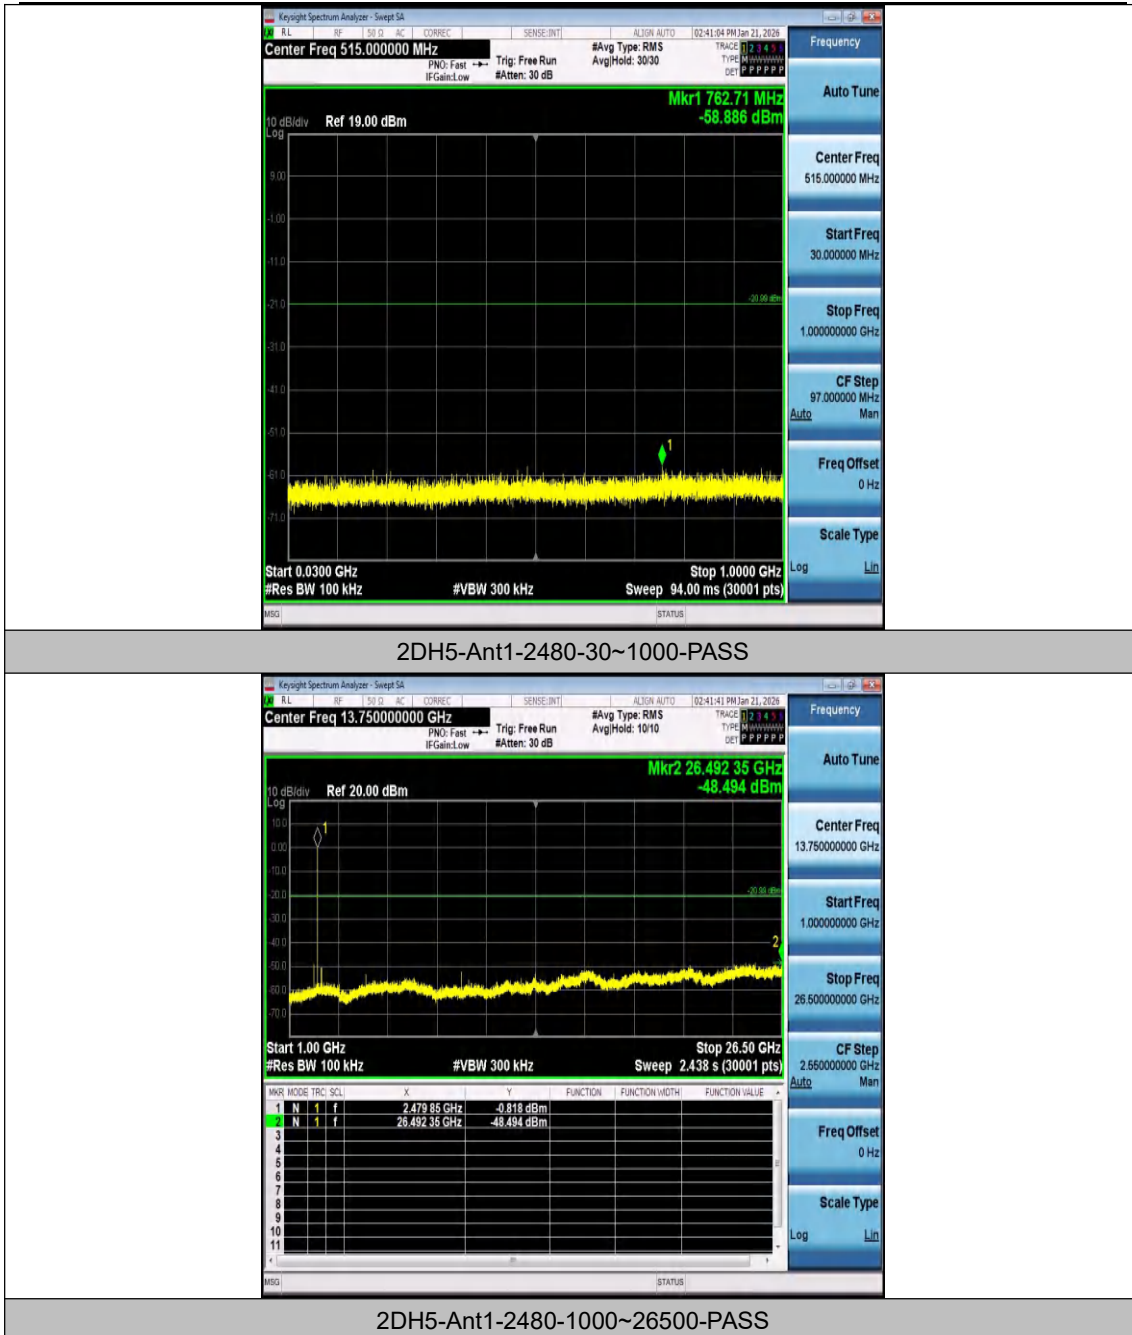

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

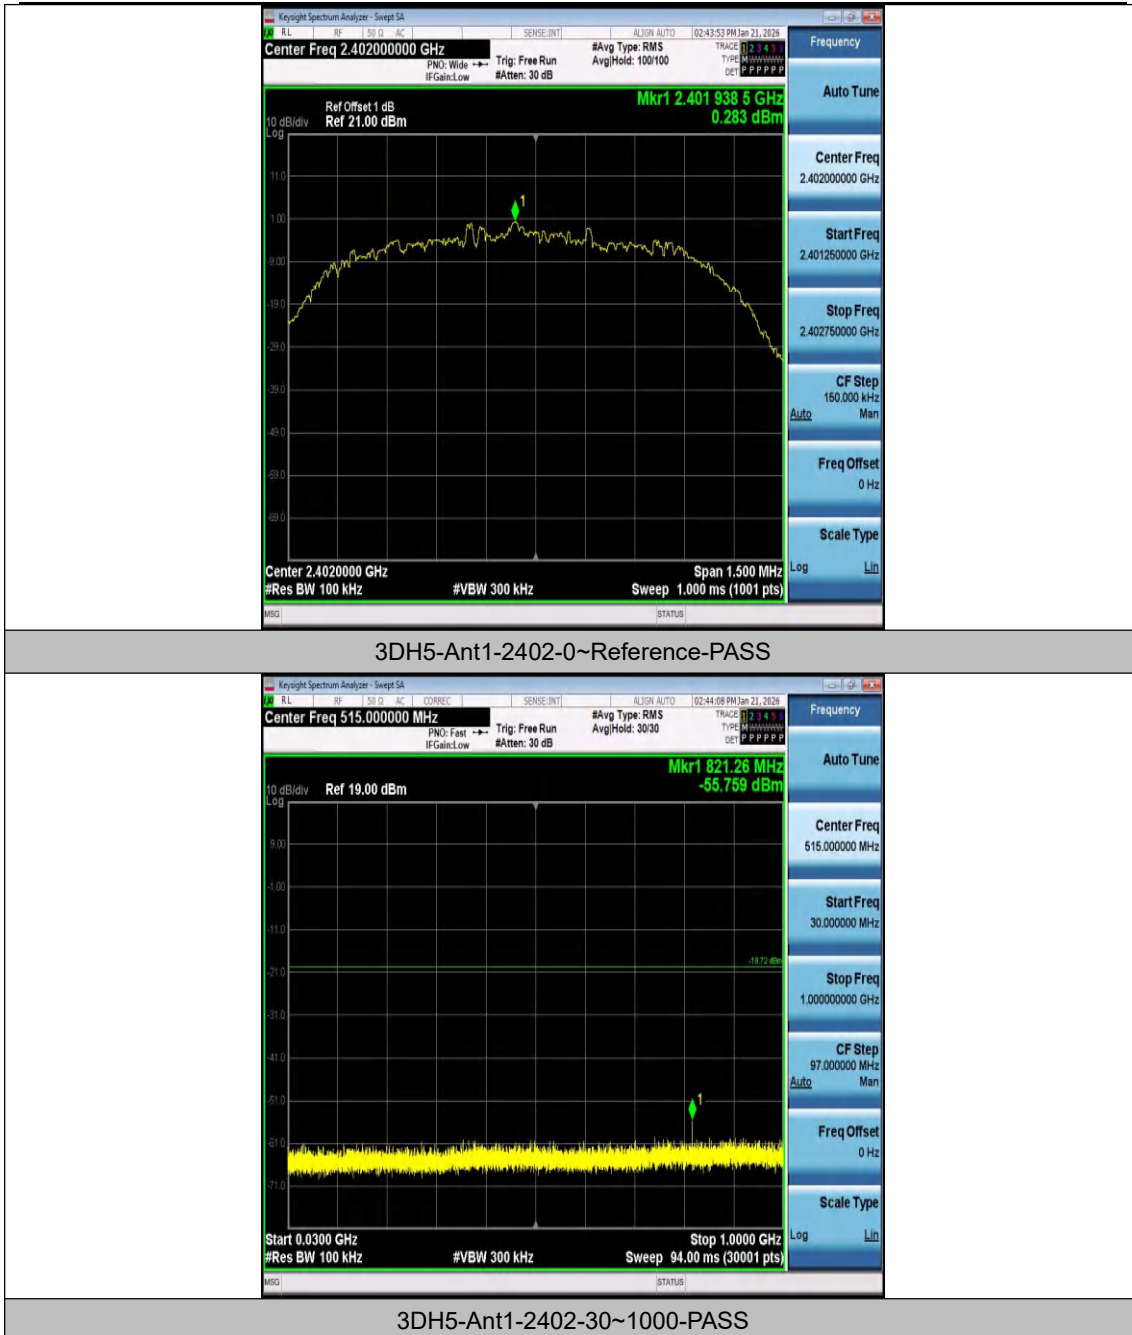

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

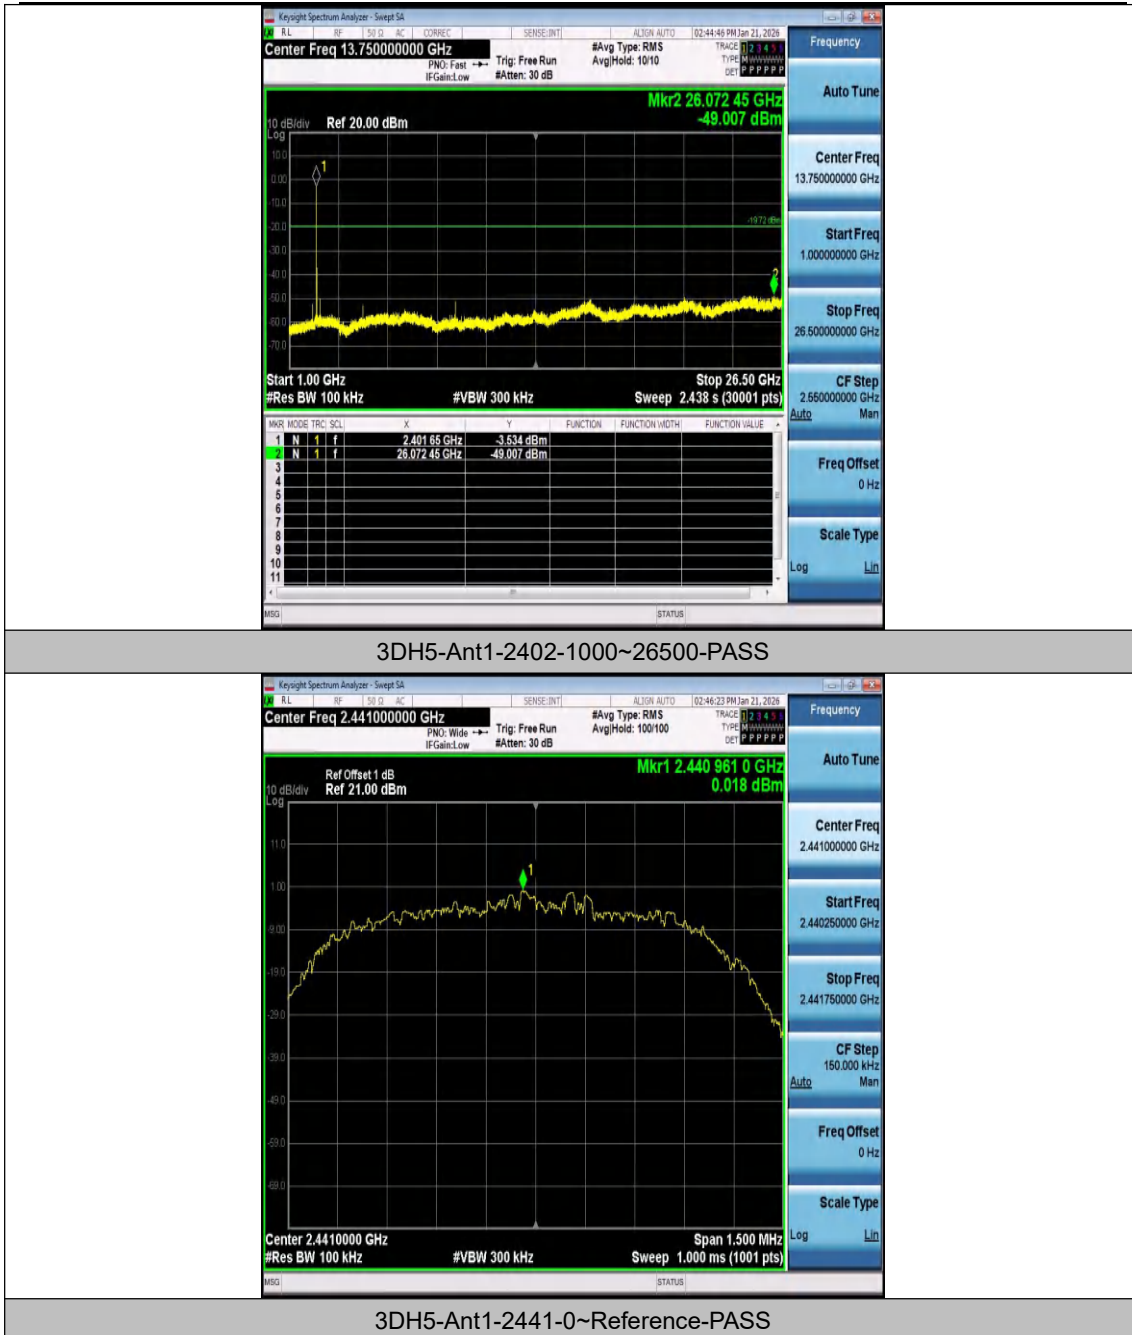

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

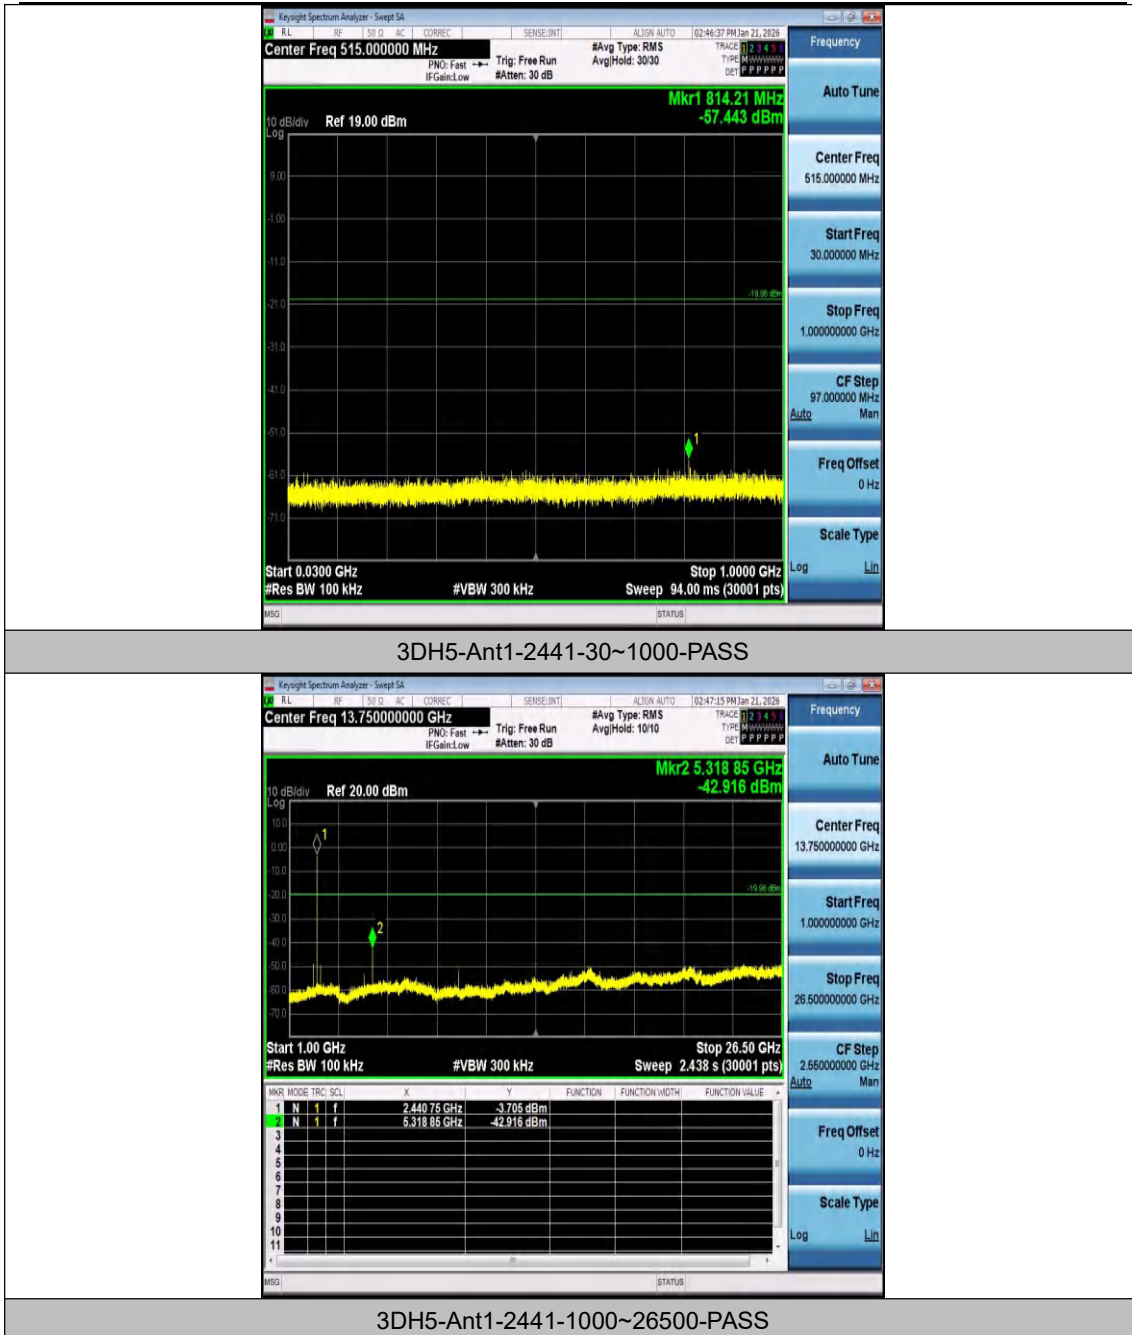

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

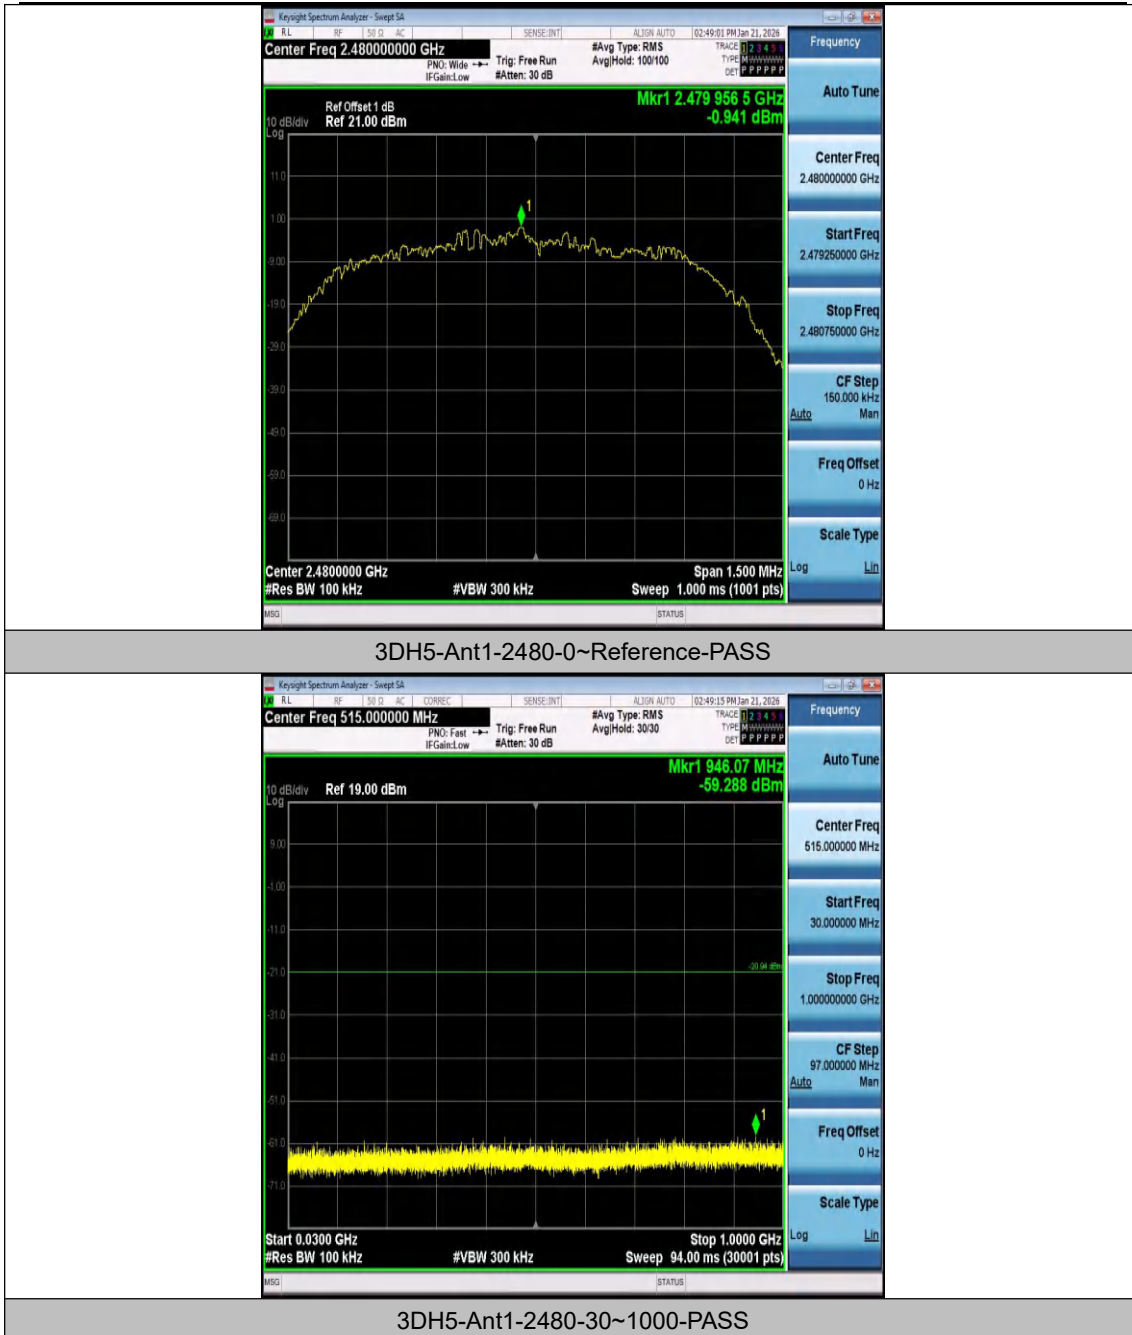

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

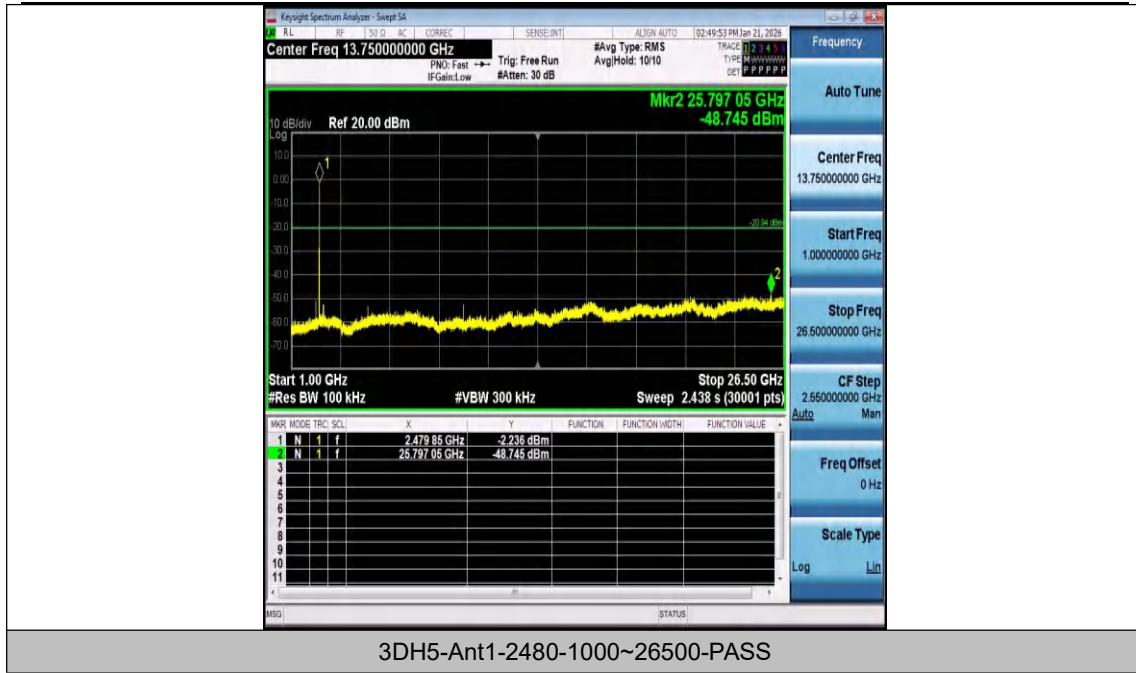

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix I: Duty Cycle


Test Result


Test Mode	Antenna	Frequency[MHz]	ON Time [ms]	Period [ms]	Duty Cycle [%]	Duty Cycle Factor[dB]
DH5	Ant1	2402	2.88	3.75	76.80	1.15
DH5	Ant1	2441	2.89	3.75	77.07	1.13
DH5	Ant1	2480	2.89	3.75	77.07	1.13
2DH5	Ant1	2402	2.90	3.75	77.33	1.12
2DH5	Ant1	2441	2.91	3.75	77.60	1.10
2DH5	Ant1	2480	2.90	3.75	77.33	1.12
3DH5	Ant1	2402	2.89	3.75	77.07	1.13
3DH5	Ant1	2441	2.89	3.75	77.07	1.13
3DH5	Ant1	2480	2.89	3.75	77.07	1.13


Test Graphs

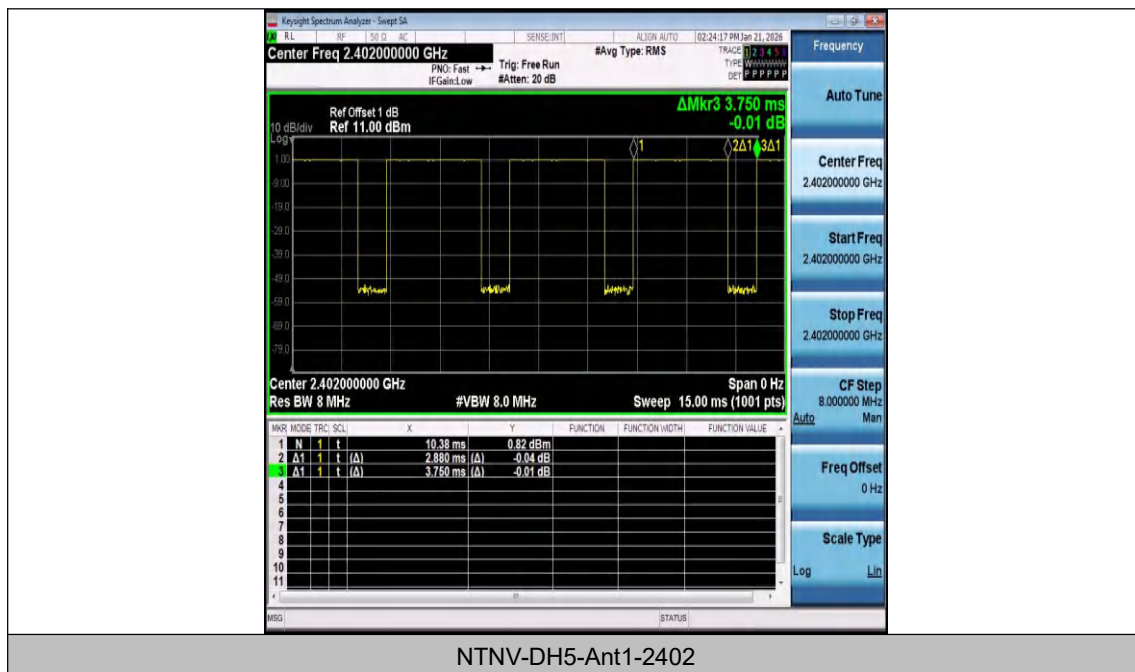

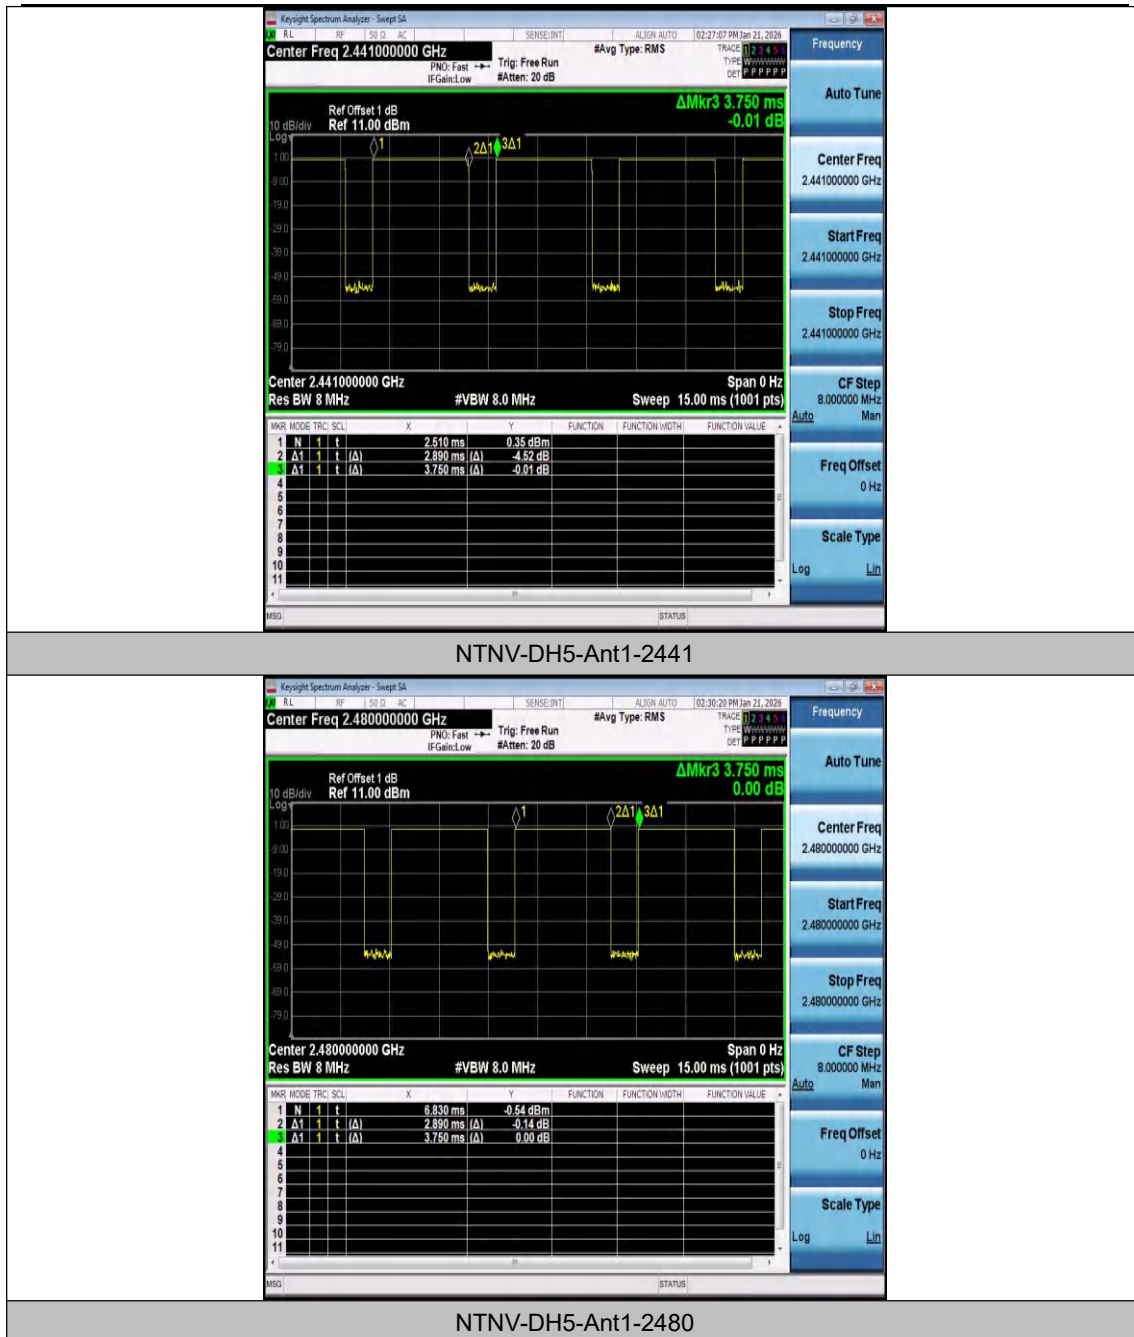

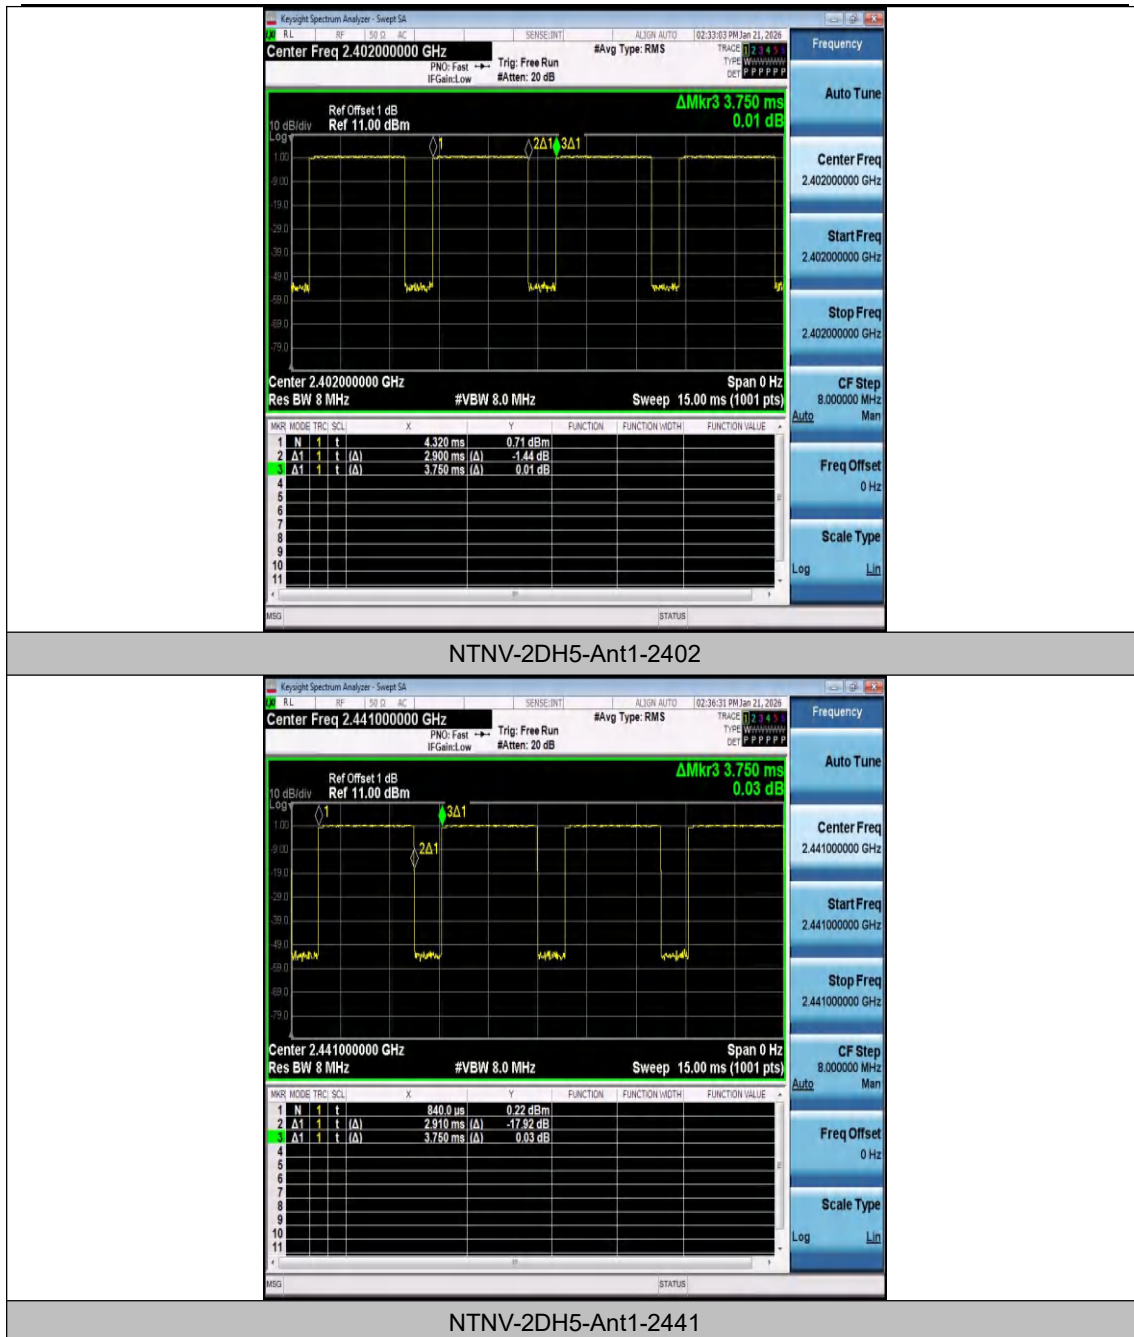

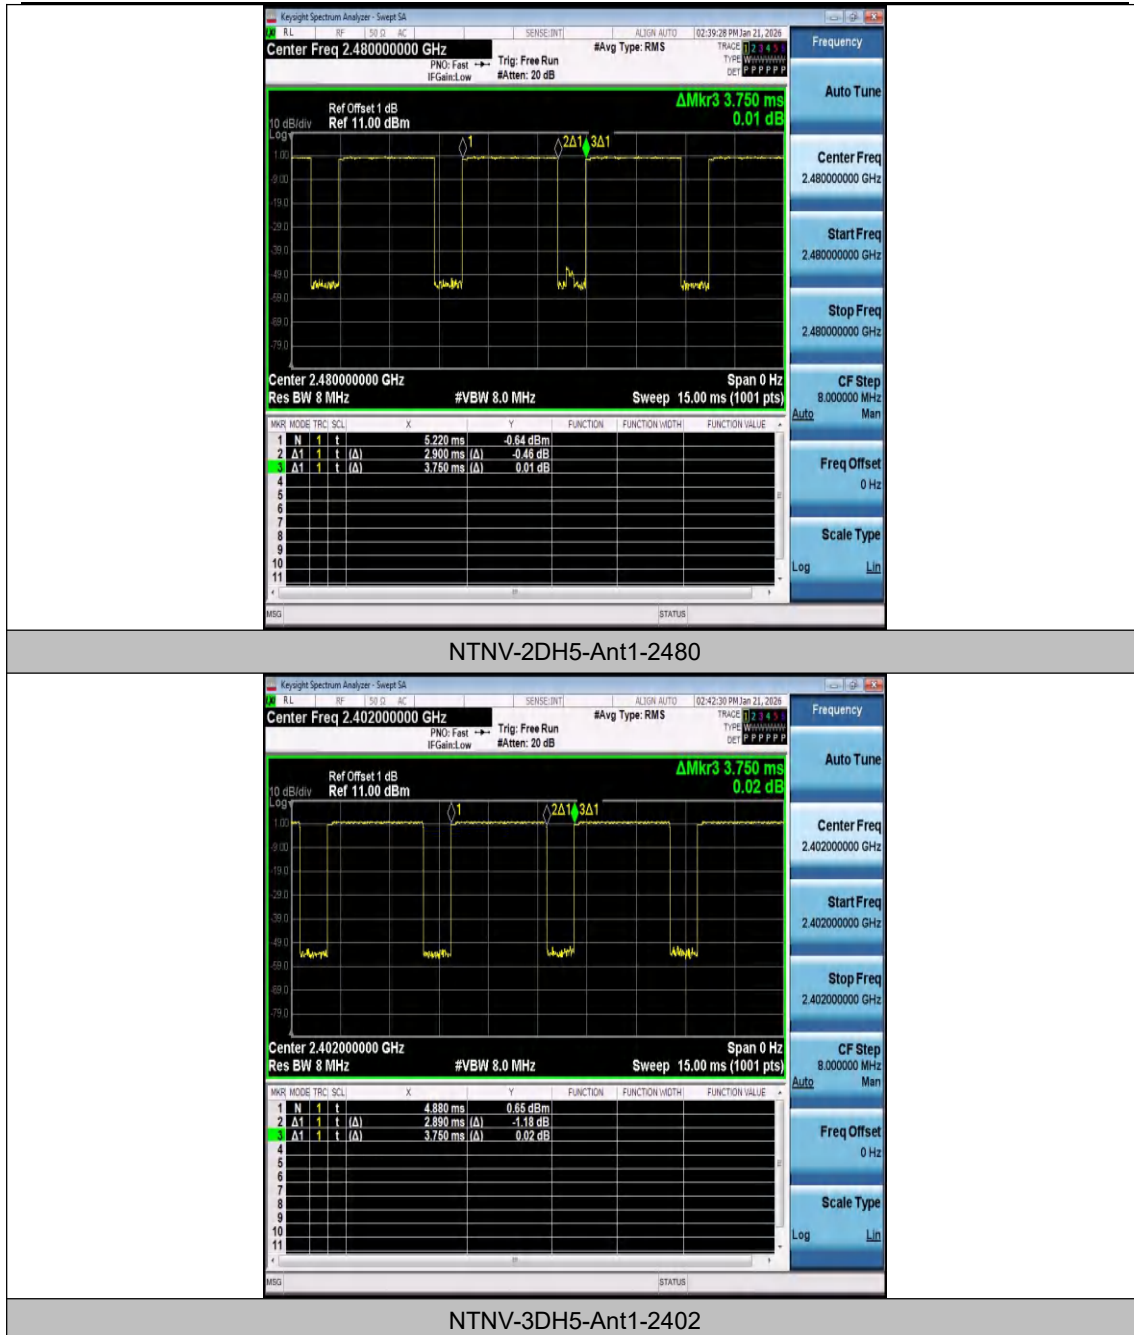

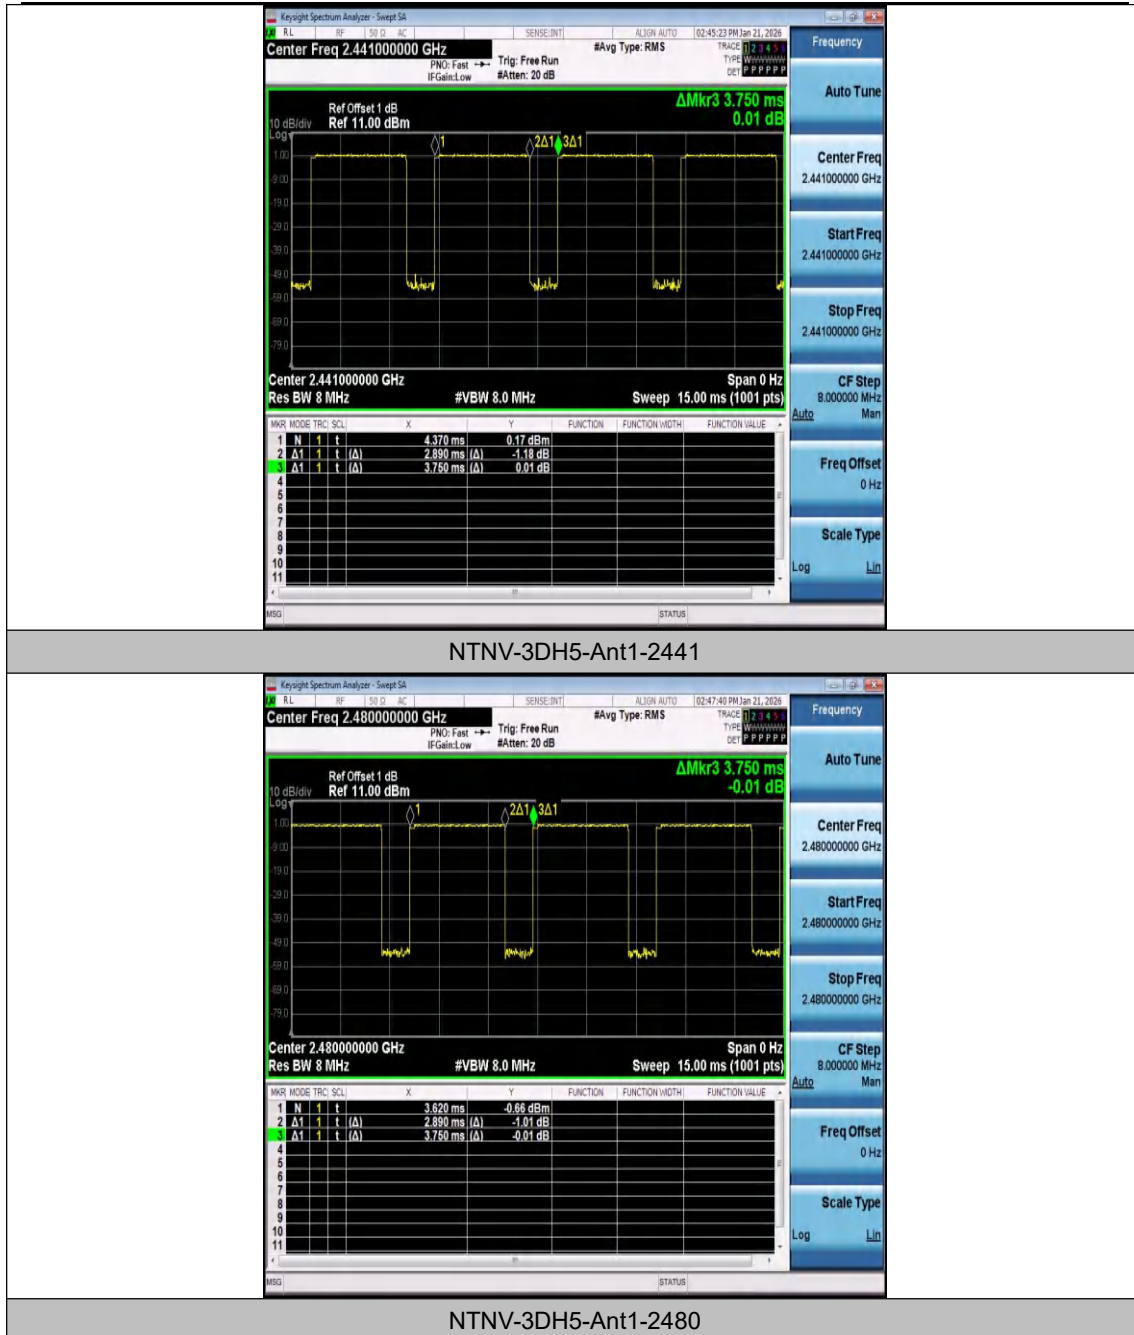

---End---