



-26dB Bandwidth NVNT ax40 5550MHz Ant1

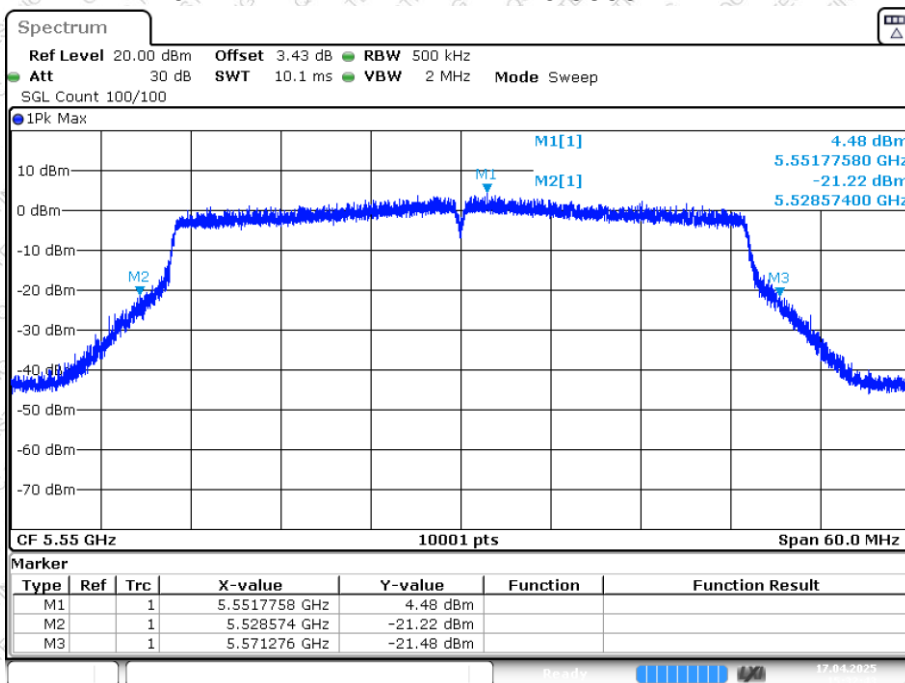

Date: 17.APR.2025 15:32:43


-26dB Bandwidth NVNT ax40 5670MHz Ant1

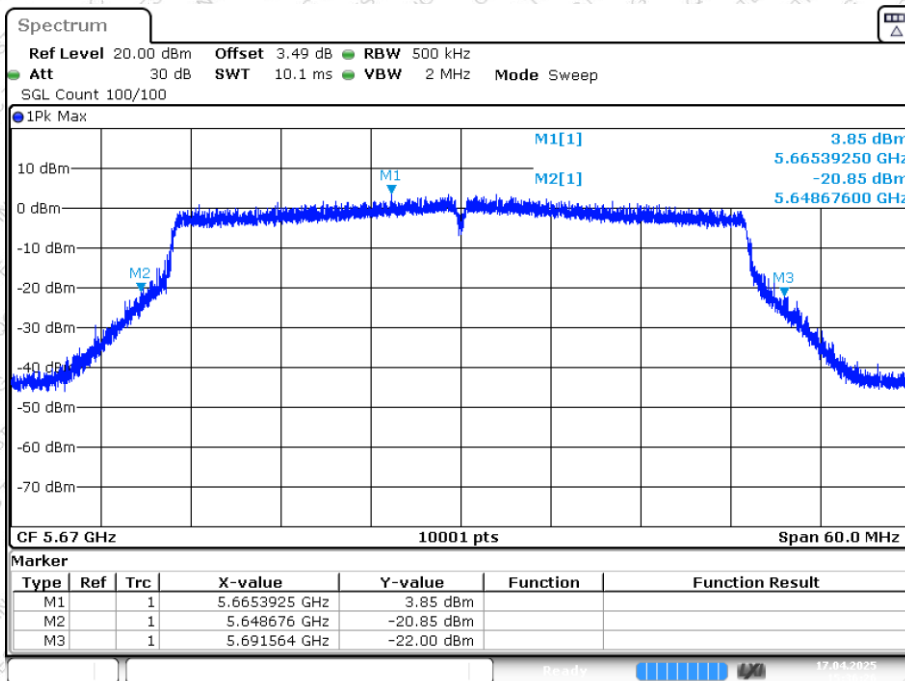


(Date: 17.APR.2025 15:36:26)



-26dB Bandwidth NVNT ax40 5710MHz Ant1

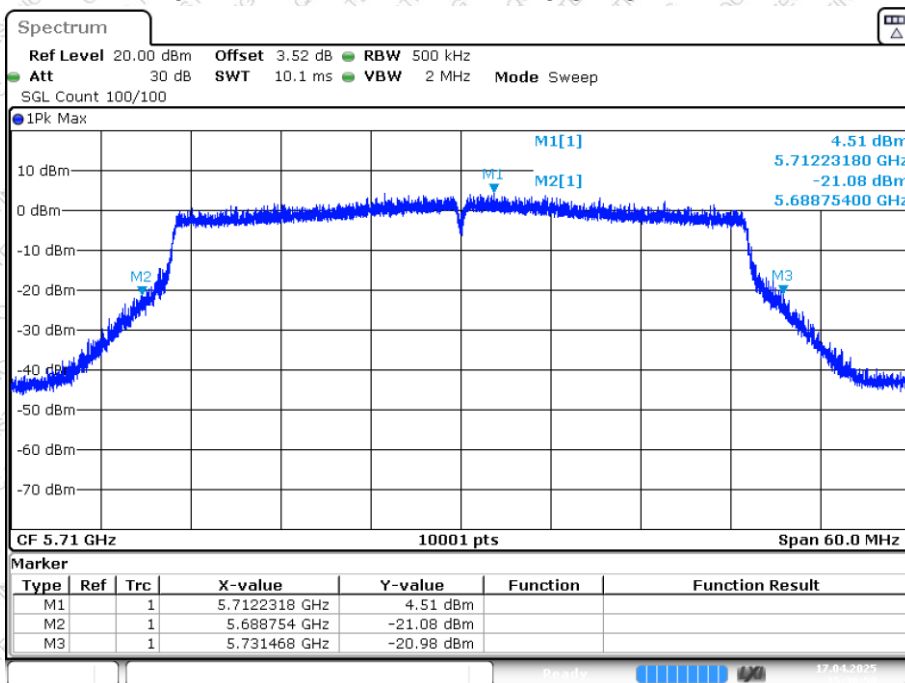


-26dB Bandwidth NVNT ax80 5210MHz Ant1

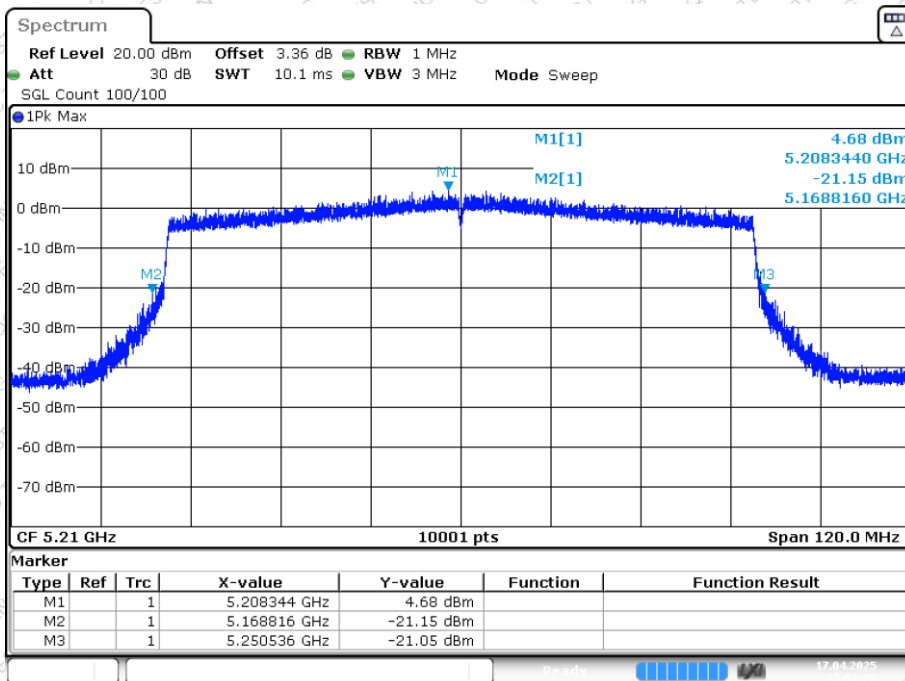




-26dB Bandwidth NVNT ax80 5290MHz Ant1

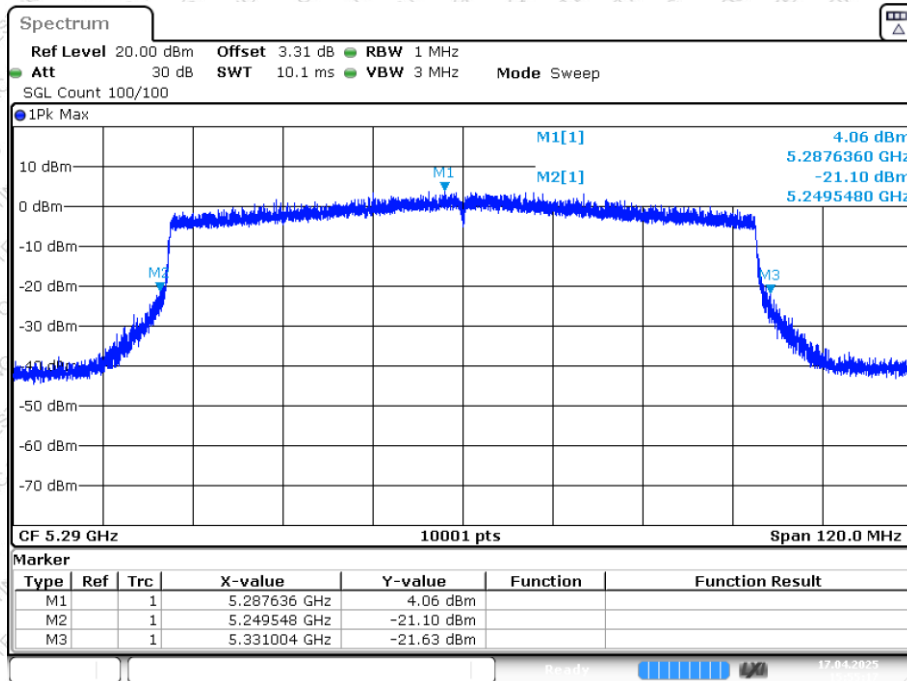


-26dB Bandwidth NVNT ax80 5530MHz Ant1

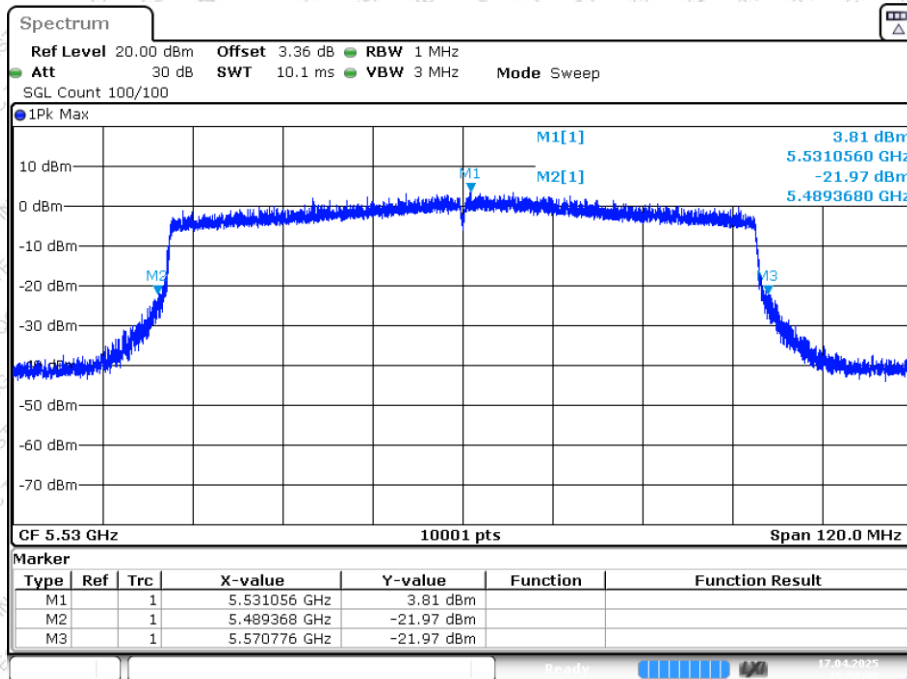




-26dB Bandwidth NVNT ax80 5610MHz Ant1

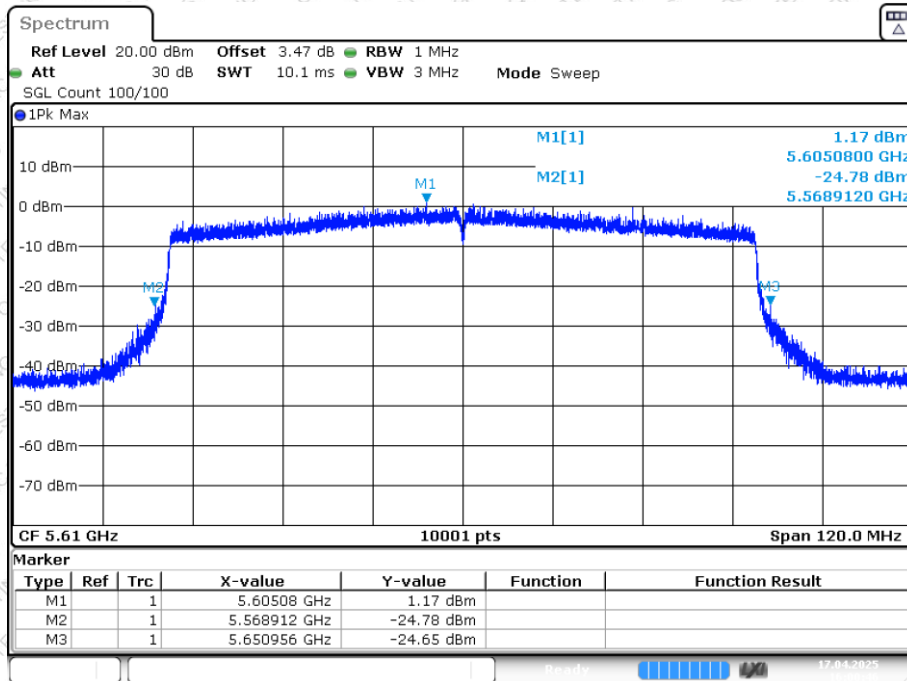

Date: 17. APR 2025 16:00:46


-26dB Bandwidth NVNT ax80 5690MHz Ant1

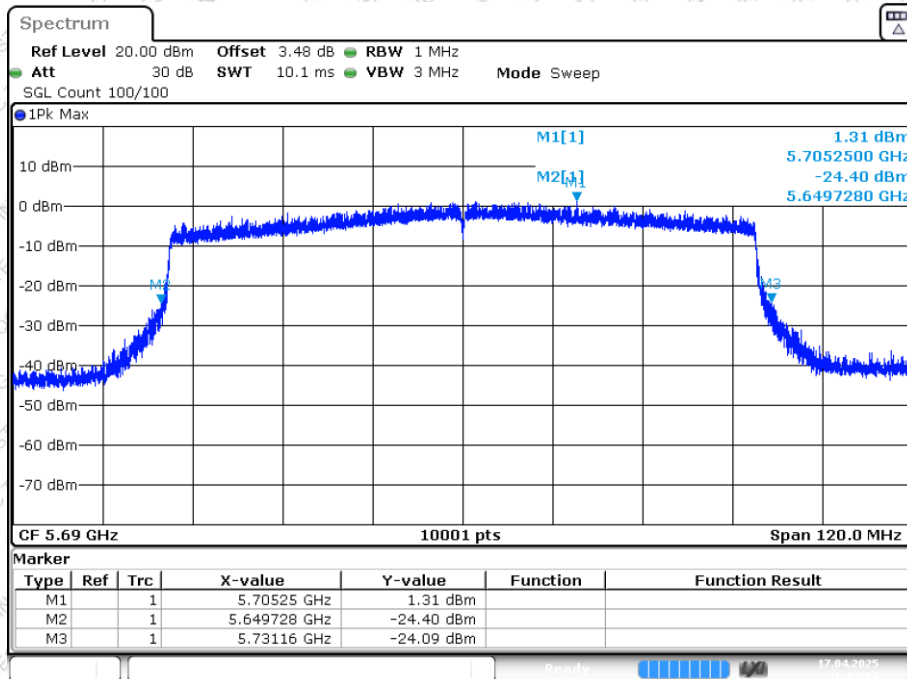


Date: 17. APR 2025 16:03:05



-26dB Bandwidth NVNT ax160 5250MHz Ant1

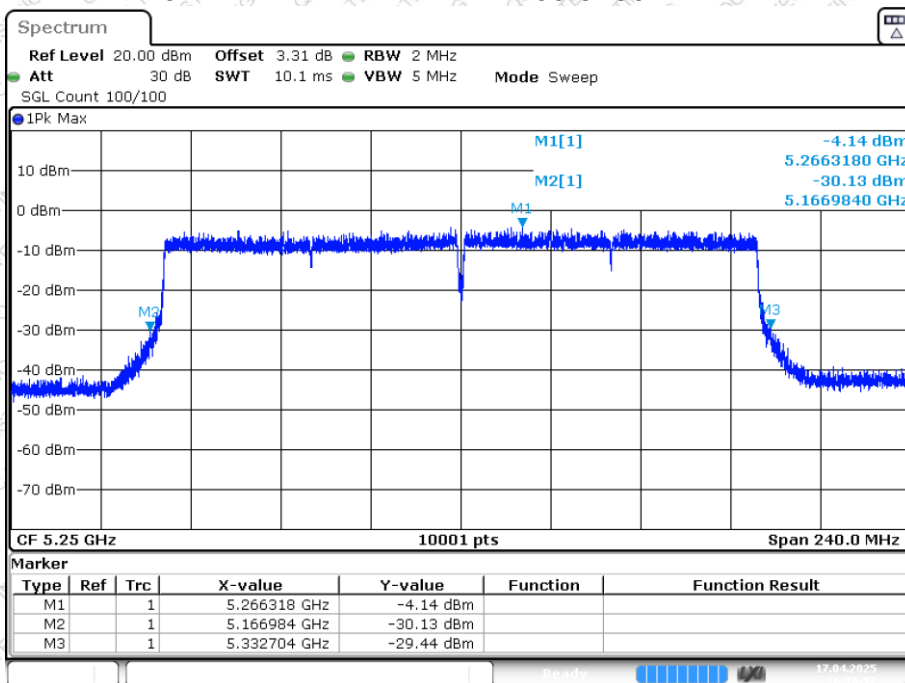

-26dB Bandwidth NVNT ax160 5570MHz Ant1

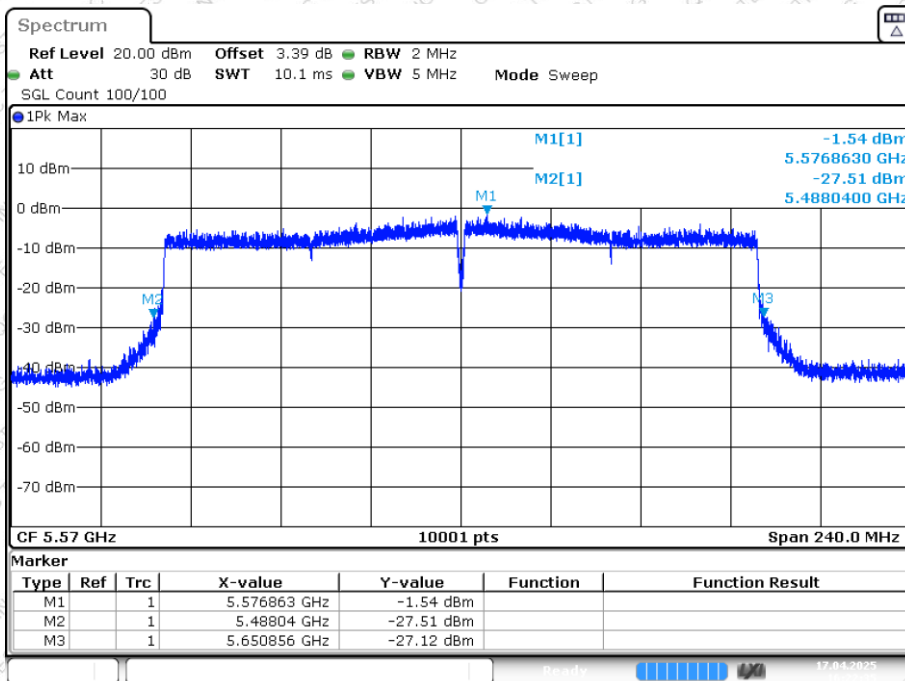




-6dB Bandwidth Test result:


Mode	Frequency (MHz)	Antenna	-6 dB Bandwidth (MHz)	Limit -6 dB Bandwidth (MHz)	Verdict
a	5745	Ant1	15.318	≥0.5	Pass
a	5785	Ant1	15.093	≥0.5	Pass
a	5825	Ant1	15.054	≥0.5	Pass
n20	5745	Ant1	17.52	≥0.5	Pass
n20	5785	Ant1	17.508	≥0.5	Pass
n20	5825	Ant1	15.348	≥0.5	Pass
n40	5755	Ant1	32.622	≥0.5	Pass
n40	5795	Ant1	34.644	≥0.5	Pass
ac20	5745	Ant1	15.291	≥0.5	Pass
ac20	5785	Ant1	17.487	≥0.5	Pass
ac20	5825	Ant1	17.541	≥0.5	Pass
ac40	5755	Ant1	33.912	≥0.5	Pass
ac40	5795	Ant1	35.418	≥0.5	Pass
ac80	5775	Ant1	73.812	≥0.5	Pass
ax20	5745	Ant1	18.942	≥0.5	Pass
ax20	5785	Ant1	18.798	≥0.5	Pass
ax20	5825	Ant1	18.855	≥0.5	Pass
ax40	5755	Ant1	37.56	≥0.5	Pass
ax40	5795	Ant1	37.95	≥0.5	Pass
ax80	5775	Ant1	66.564	≥0.5	Pass



-6dB Bandwidth NVNT a 5745MHz Ant1

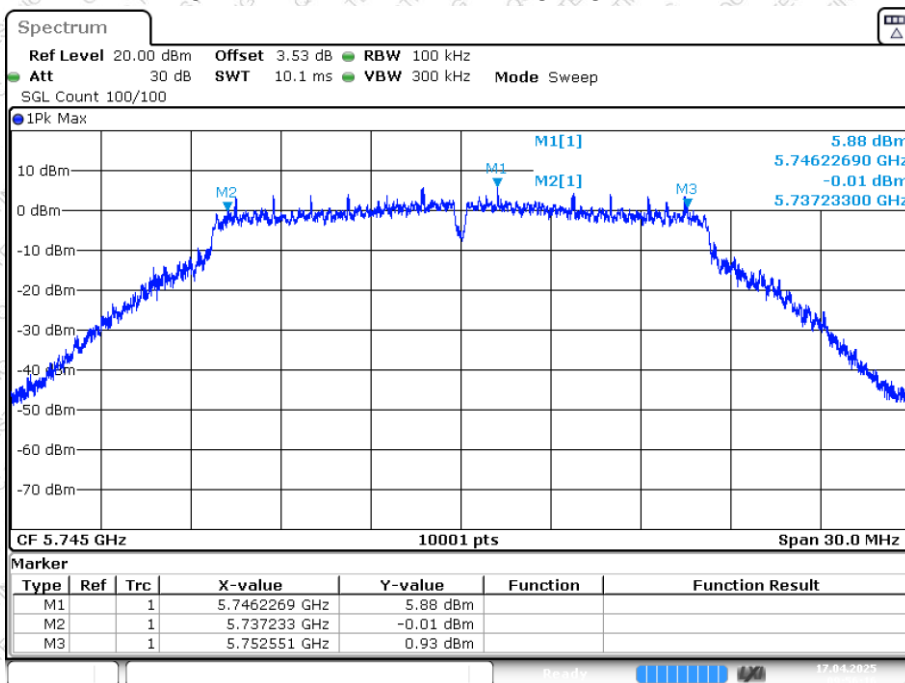


-6dB Bandwidth NVNT a 5785MHz Ant1

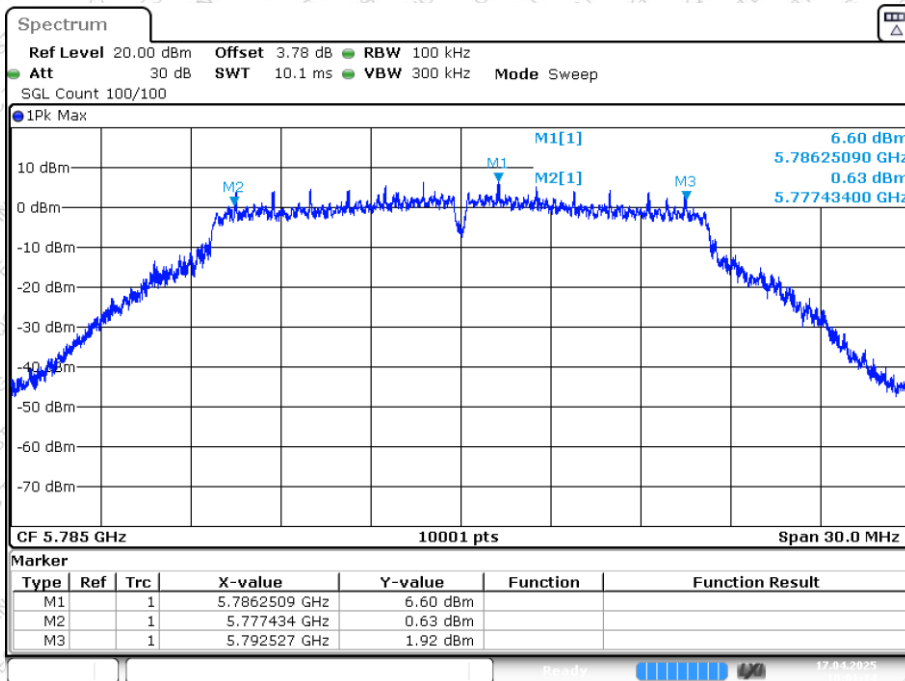




-6dB Bandwidth NVNT a 5825MHz Ant1

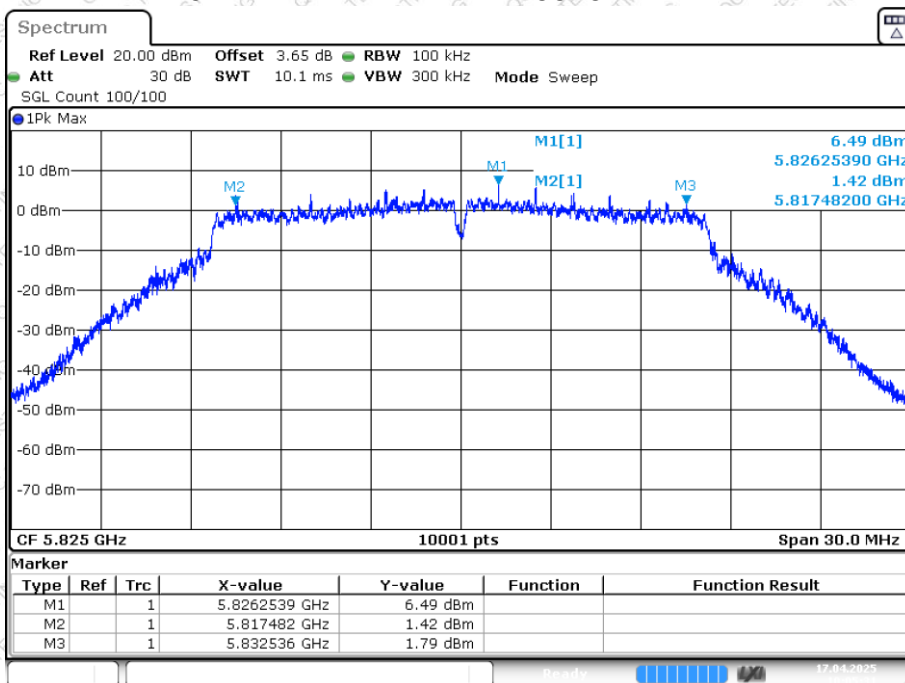

Date: 17. APR 2025 10:05:31


-6dB Bandwidth NVNT n20 5745MHz Ant1

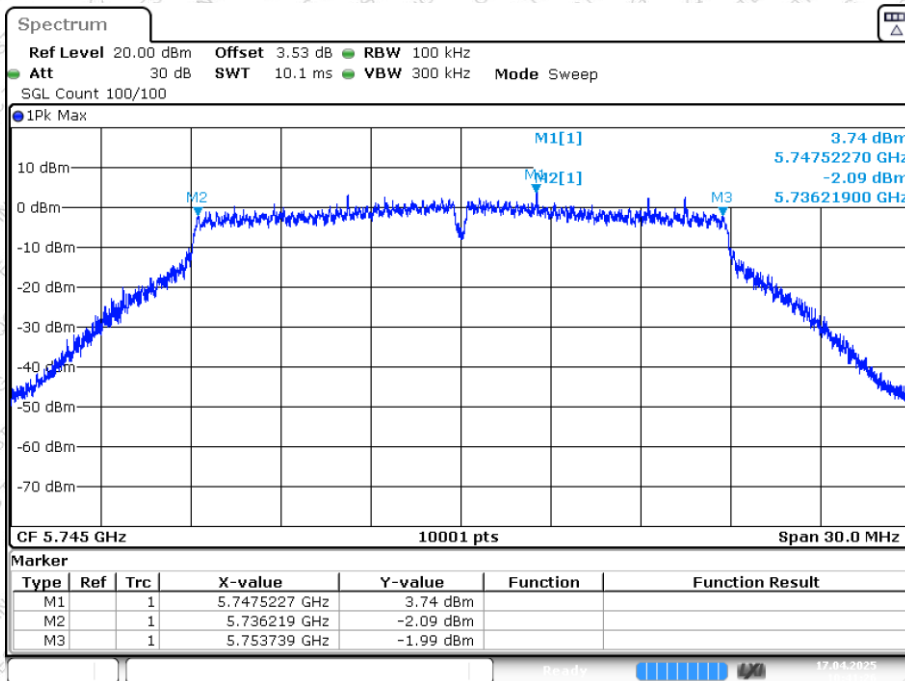


Date: 17. APR 2025 10:41:27



-6dB Bandwidth NVNT n20 5785MHz Ant1

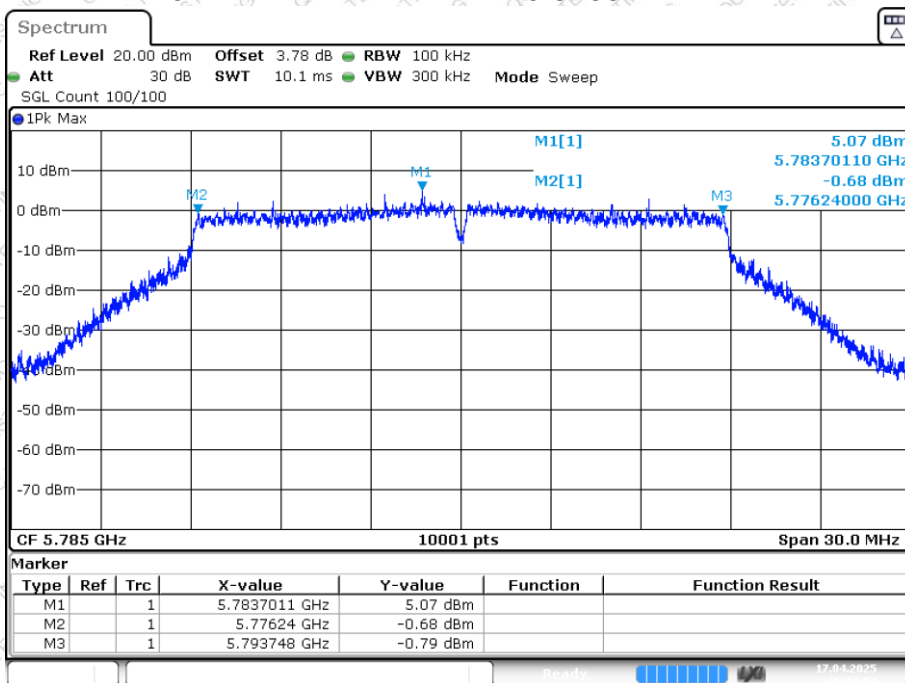


-6dB Bandwidth NVNT n20 5825MHz Ant1

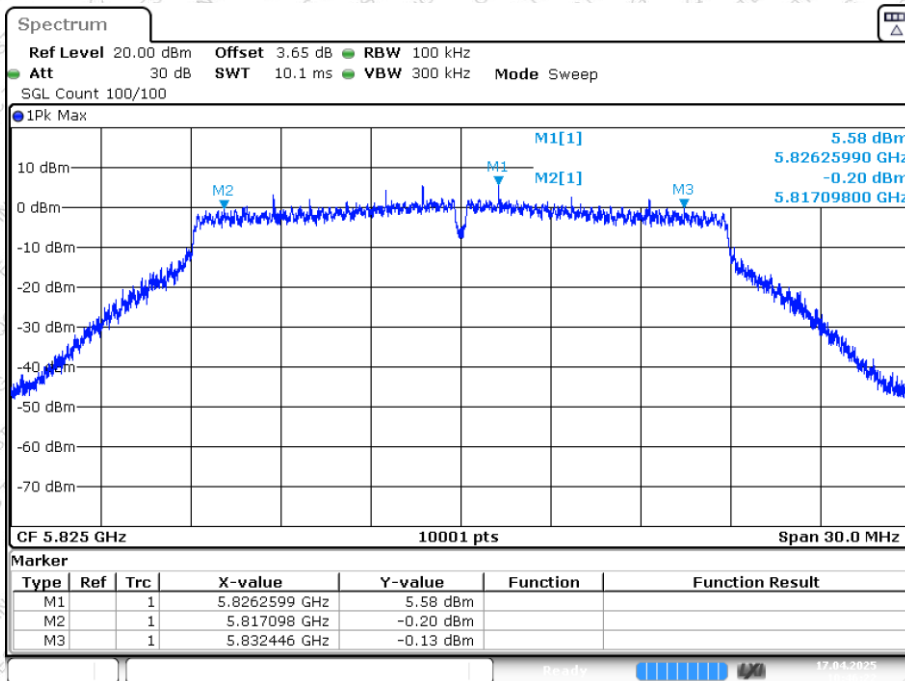




-6dB Bandwidth NVNT n40 5755MHz Ant1

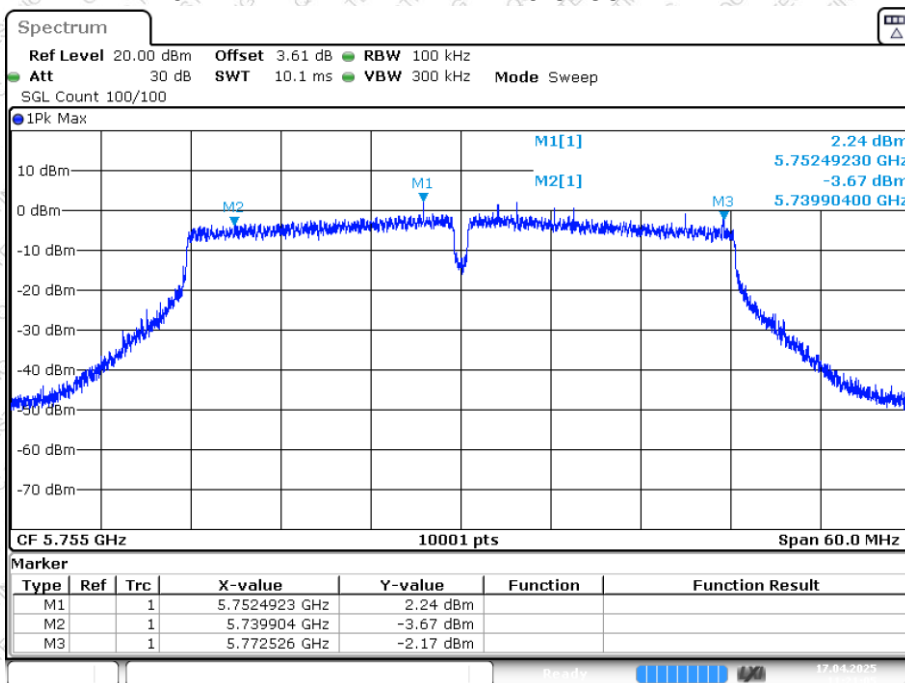


-6dB Bandwidth NVNT n40 5795MHz Ant1

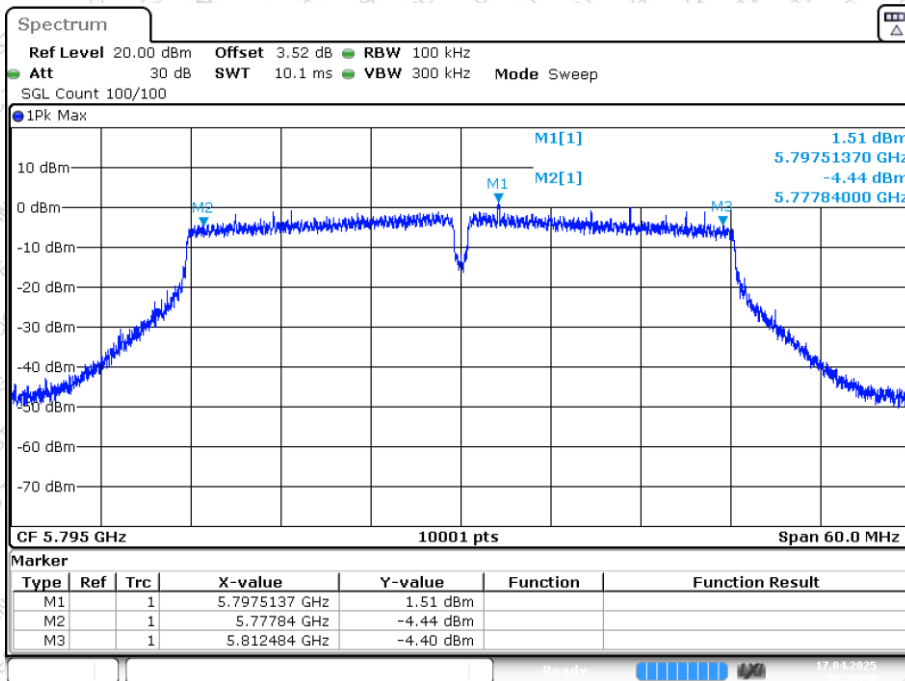




-6dB Bandwidth NVNT ac20 5745MHz Ant1

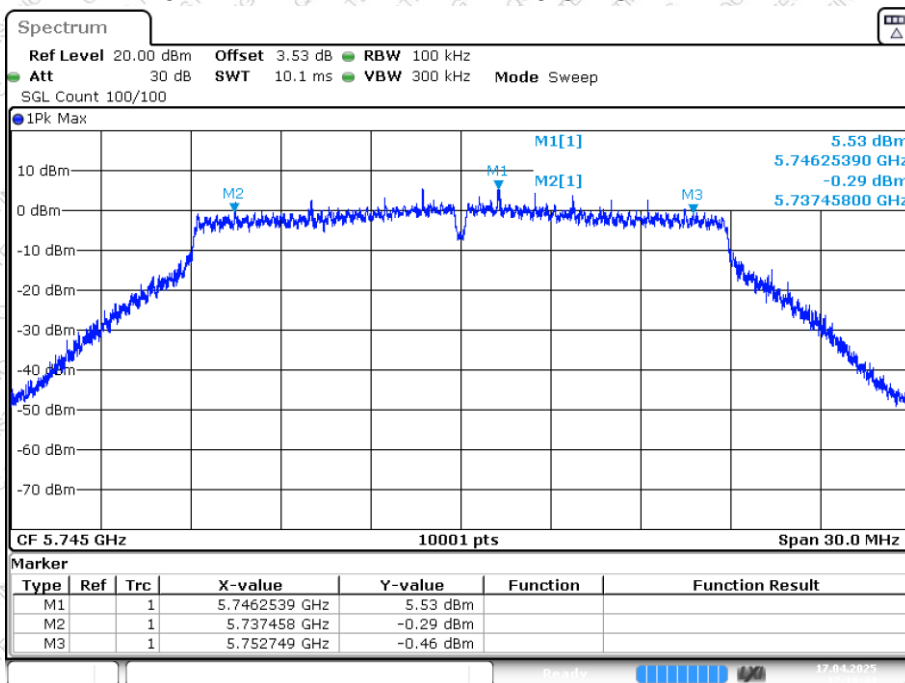


-6dB Bandwidth NVNT ac20 5785MHz Ant1

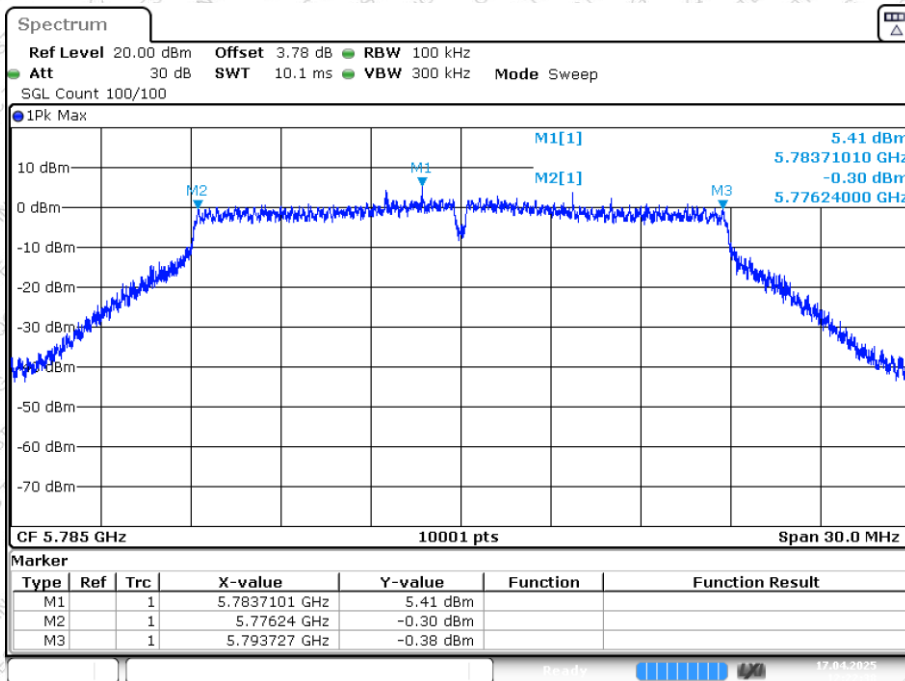




-6dB Bandwidth NVNT ac20 5825MHz Ant1

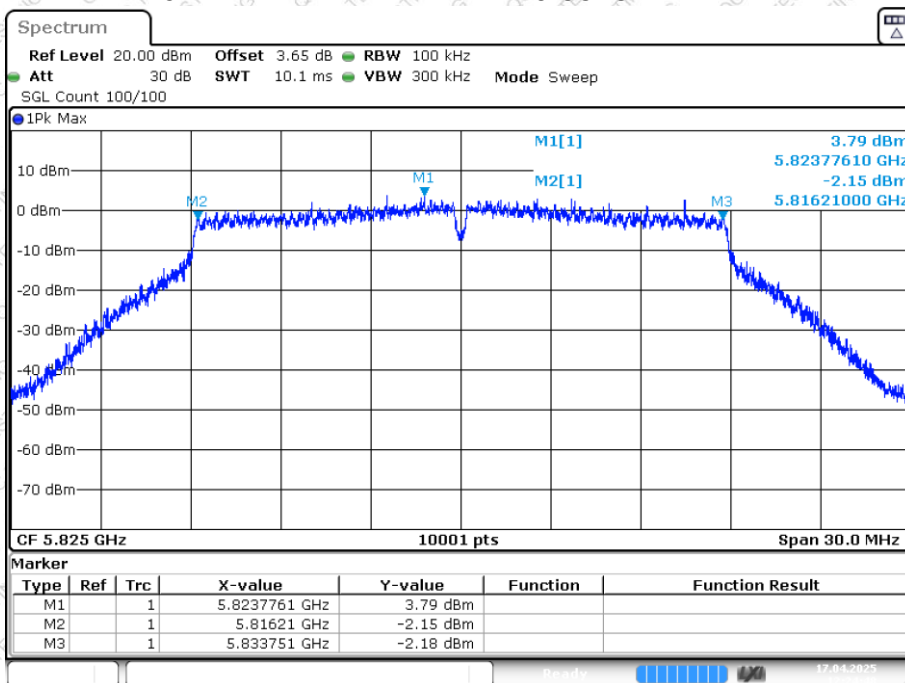


-6dB Bandwidth NVNT ac40 5755MHz Ant1

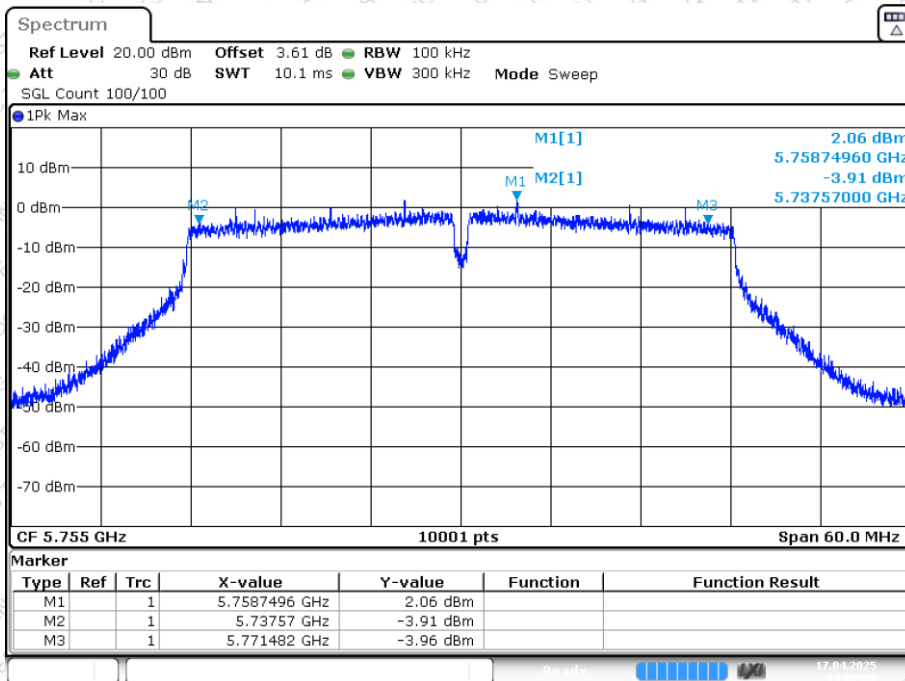




-6dB Bandwidth NVNT ac40 5795MHz Ant1

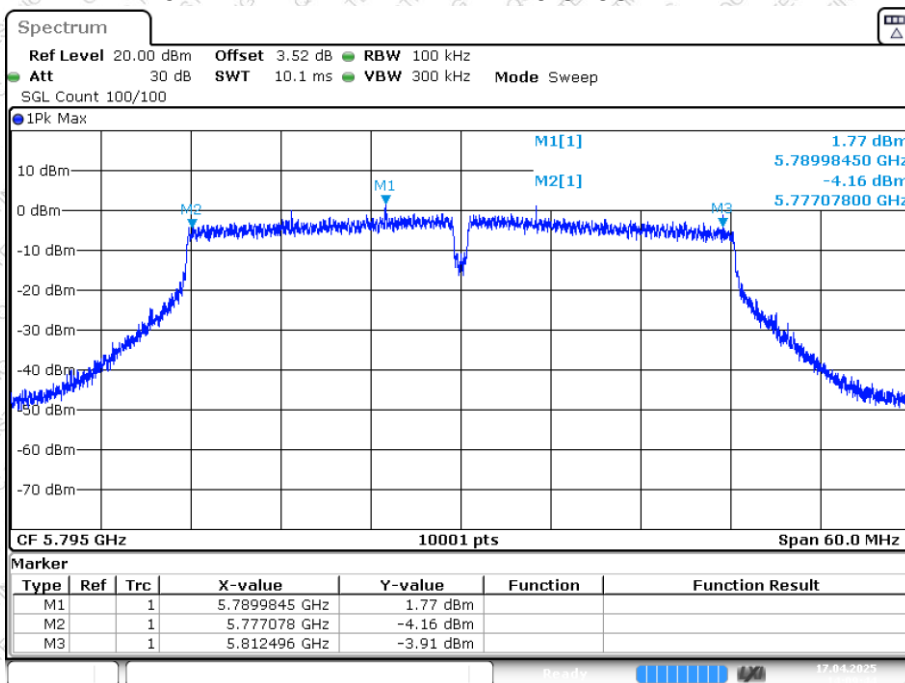


-6dB Bandwidth NVNT ac80 5775MHz Ant1

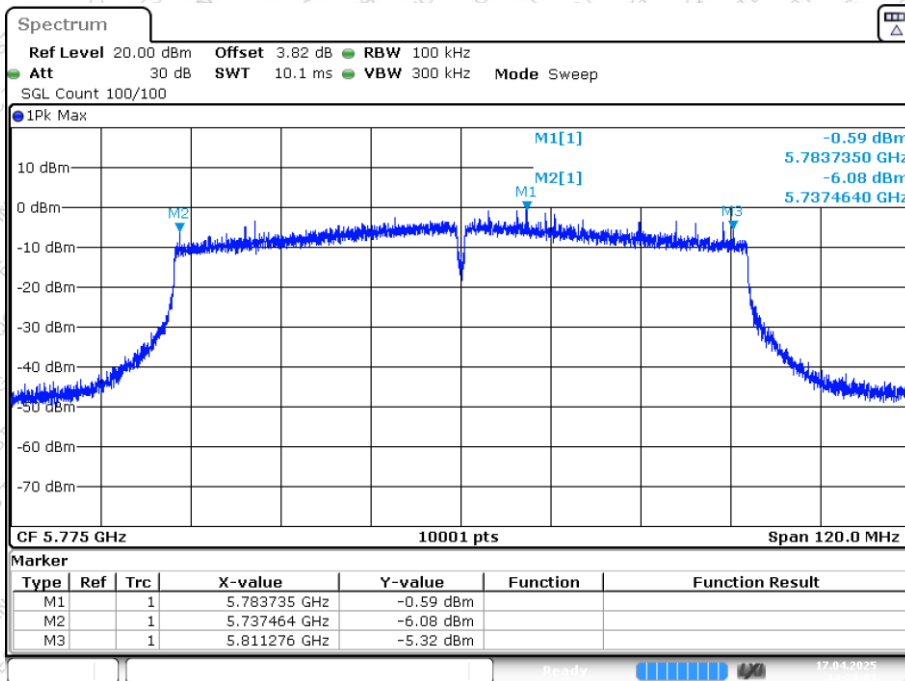




-6dB Bandwidth NVNT ax20 5745MHz Ant1

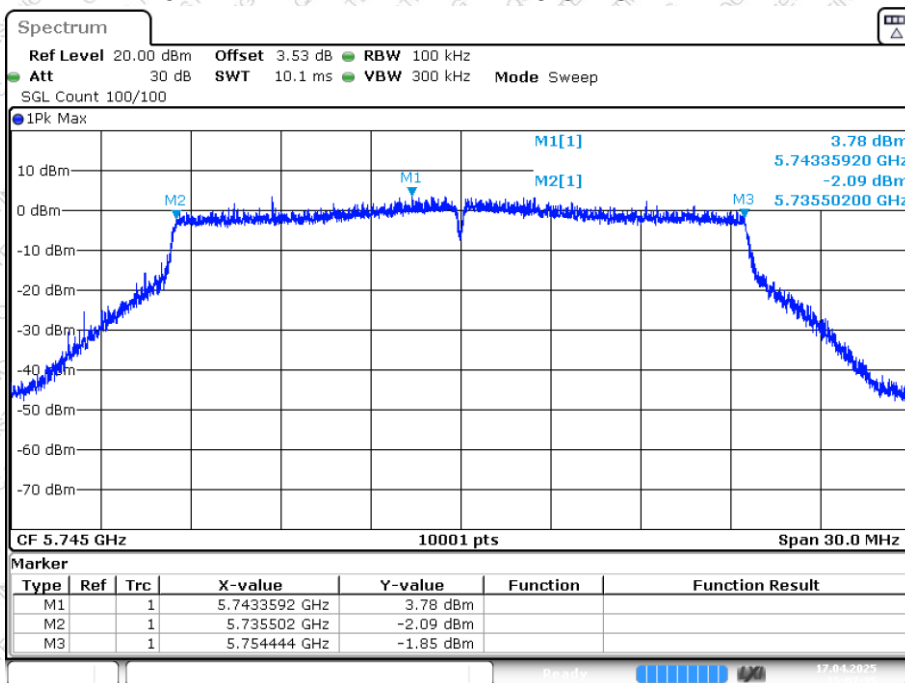


-6dB Bandwidth NVNT ax20 5785MHz Ant1

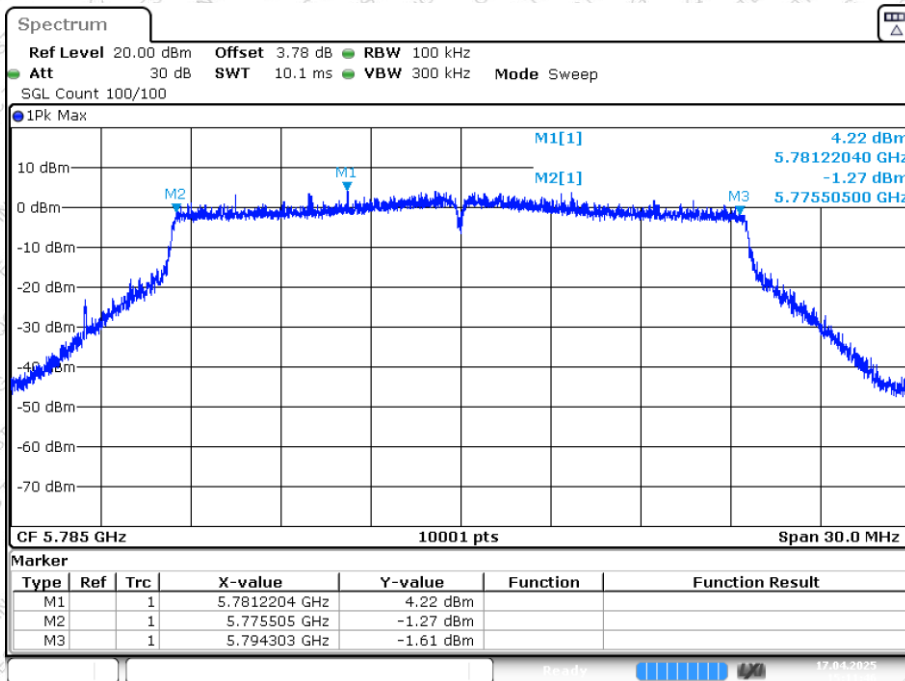




-6dB Bandwidth NVNT ax20 5825MHz Ant1

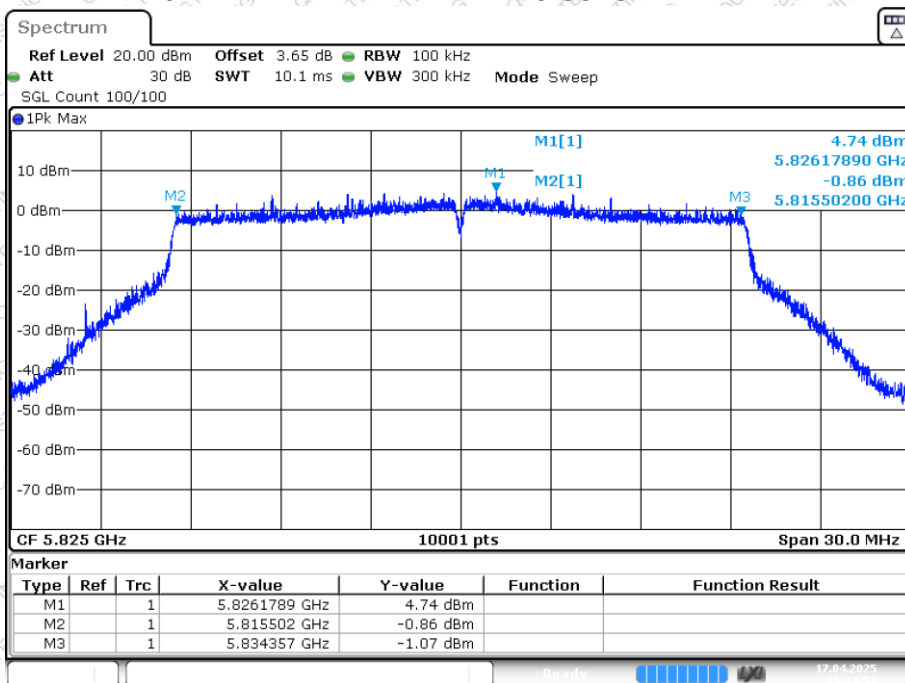

Date: 17. APR 2025 15:14:52


-6dB Bandwidth NVNT ax40 5755MHz Ant1

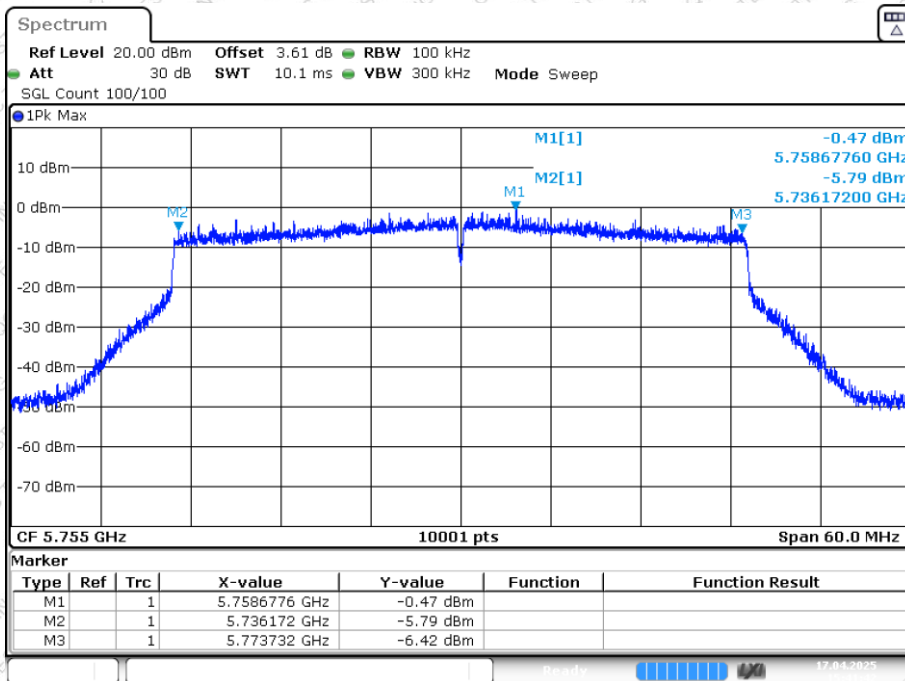


Date: 17. APR 2025 15:41:43



-6dB Bandwidth NVNT ax40 5795MHz Ant1

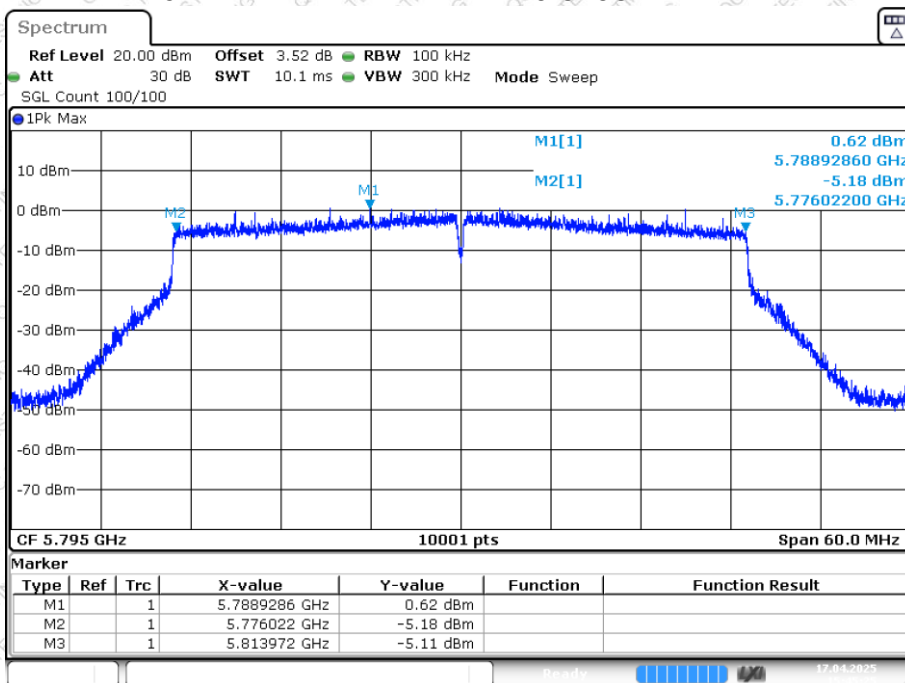

-6dB Bandwidth NVNT ax80 5775MHz Ant1

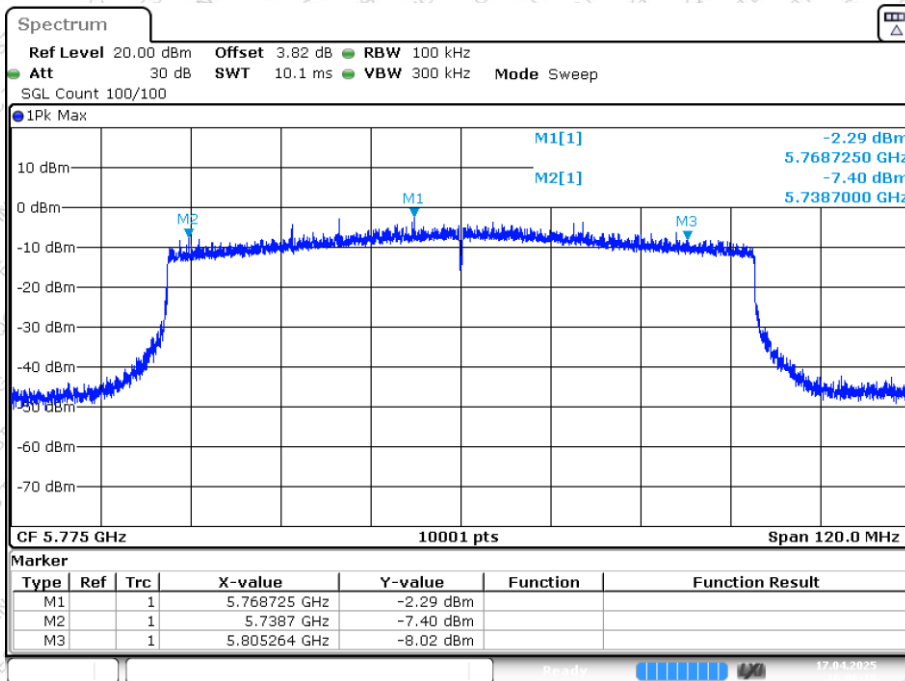



99% Bandwidth Test result:

Mode	Frequency (MHz)	Antenna	99% OBW (MHz)	Limit 99% OBW (MHz)	Verdict
a	5180	Ant1	16.792	/	Pass
a	5200	Ant1	16.843	/	Pass
a	5240	Ant1	16.861	/	Pass
a	5260	Ant1	16.828	/	Pass
a	5300	Ant1	16.867	/	Pass
a	5320	Ant1	16.84	/	Pass
a	5500	Ant1	16.816	/	Pass
a	5580	Ant1	16.876	/	Pass
a	5700	Ant1	16.822	/	Pass
a	5720	Ant1	16.84	/	Pass
a	5745	Ant1	16.846	/	Pass
a	5785	Ant1	16.819	/	Pass
a	5825	Ant1	16.879	/	Pass
n20	5180	Ant1	17.782	/	Pass
n20	5200	Ant1	17.806	/	Pass
n20	5240	Ant1	17.791	/	Pass
n20	5260	Ant1	17.812	/	Pass
n20	5300	Ant1	17.797	/	Pass
n20	5320	Ant1	17.788	/	Pass
n20	5500	Ant1	17.953	/	Pass
n20	5580	Ant1	17.824	/	Pass
n20	5700	Ant1	17.803	/	Pass
n20	5720	Ant1	17.944	/	Pass
n20	5745	Ant1	17.818	/	Pass
n20	5785	Ant1	17.962	/	Pass
n20	5825	Ant1	17.809	/	Pass
n40	5190	Ant1	36.29	/	Pass
n40	5230	Ant1	36.278	/	Pass
n40	5270	Ant1	36.26	/	Pass
n40	5310	Ant1	36.284	/	Pass
n40	5510	Ant1	36.302	/	Pass
n40	5550	Ant1	36.26	/	Pass
n40	5670	Ant1	36.266	/	Pass
n40	5710	Ant1	36.278	/	Pass
n40	5755	Ant1	36.26	/	Pass
n40	5795	Ant1	36.278	/	Pass
ac20	5180	Ant1	17.785	/	Pass
ac20	5200	Ant1	17.806	/	Pass
ac20	5240	Ant1	17.794	/	Pass




ac20	5260	Ant1	17.812	/	Pass
ac20	5300	Ant1	17.791	/	Pass
ac20	5320	Ant1	17.791	/	Pass
ac20	5500	Ant1	17.773	/	Pass
ac20	5580	Ant1	17.821	/	Pass
ac20	5700	Ant1	17.779	/	Pass
ac20	5720	Ant1	17.98	/	Pass
ac20	5745	Ant1	17.809	/	Pass
ac20	5785	Ant1	17.965	/	Pass
ac20	5825	Ant1	17.824	/	Pass
ac40	5190	Ant1	36.272	/	Pass
ac40	5230	Ant1	36.26	/	Pass
ac40	5270	Ant1	36.254	/	Pass
ac40	5310	Ant1	36.278	/	Pass
ac40	5510	Ant1	36.296	/	Pass
ac40	5550	Ant1	36.278	/	Pass
ac40	5670	Ant1	36.26	/	Pass
ac40	5710	Ant1	36.278	/	Pass
ac40	5755	Ant1	36.26	/	Pass
ac40	5795	Ant1	36.266	/	Pass
ac80	5210	Ant1	75.184	/	Pass
ac80	5290	Ant1	75.196	/	Pass
ac80	5530	Ant1	75.256	/	Pass
ac80	5610	Ant1	75.268	/	Pass
ac80	5690	Ant1	75.148	/	Pass
ac80	5775	Ant1	75.148	/	Pass
ac160	5250	Ant1	155.312	/	Pass
ac160	5570	Ant1	155.432	/	Pass
ax20	5180	Ant1	18.949	/	Pass
ax20	5200	Ant1	18.958	/	Pass
ax20	5240	Ant1	18.952	/	Pass
ax20	5260	Ant1	18.946	/	Pass
ax20	5300	Ant1	18.964	/	Pass
ax20	5320	Ant1	18.943	/	Pass
ax20	5500	Ant1	18.937	/	Pass
ax20	5580	Ant1	18.955	/	Pass
ax20	5700	Ant1	18.946	/	Pass
ax20	5720	Ant1	18.955	/	Pass
ax20	5745	Ant1	18.946	/	Pass
ax20	5785	Ant1	18.946	/	Pass
ax20	5825	Ant1	18.958	/	Pass
ax40	5190	Ant1	37.808	/	Pass



ax40	5230	Ant1	37.76	/	Pass
ax40	5270	Ant1	37.784	/	Pass
ax40	5310	Ant1	37.766	/	Pass
ax40	5510	Ant1	37.814	/	Pass
ax40	5550	Ant1	37.766	/	Pass
ax40	5670	Ant1	37.766	/	Pass
ax40	5710	Ant1	37.772	/	Pass
ax40	5755	Ant1	37.754	/	Pass
ax40	5795	Ant1	37.79	/	Pass
ax80	5210	Ant1	76.84	/	Pass
ax80	5290	Ant1	76.804	/	Pass
ax80	5530	Ant1	76.864	/	Pass
ax80	5610	Ant1	76.756	/	Pass
ax80	5690	Ant1	76.72	/	Pass
ax80	5775	Ant1	76.78	/	Pass
ax160	5250	Ant1	156.896	/	Pass
ax160	5570	Ant1	156.488	/	Pass




OBW NVNT a 5180MHz Ant1

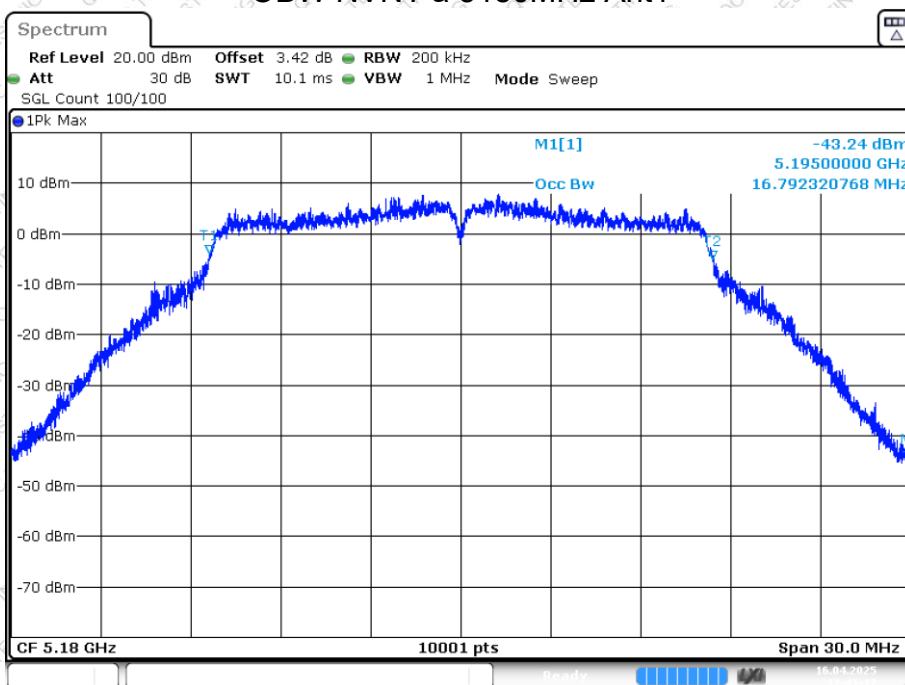

Date: 16.APR.2025 17:41:17


OBW NVNT a 5200MHz Ant1

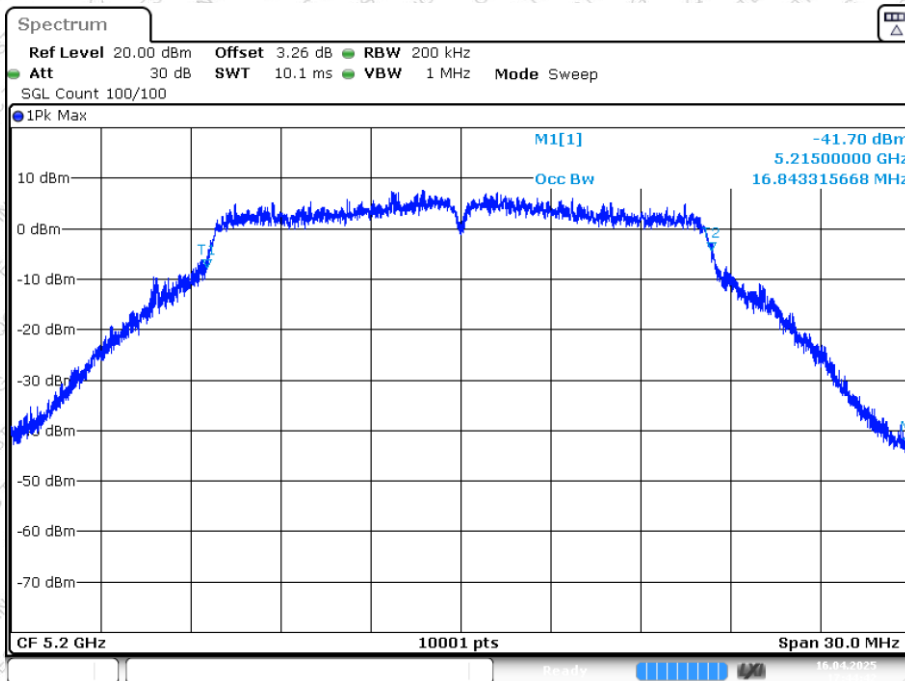

Date: 16.APR.2025 17:44:41




OBW NVNT a 5240MHz Ant1

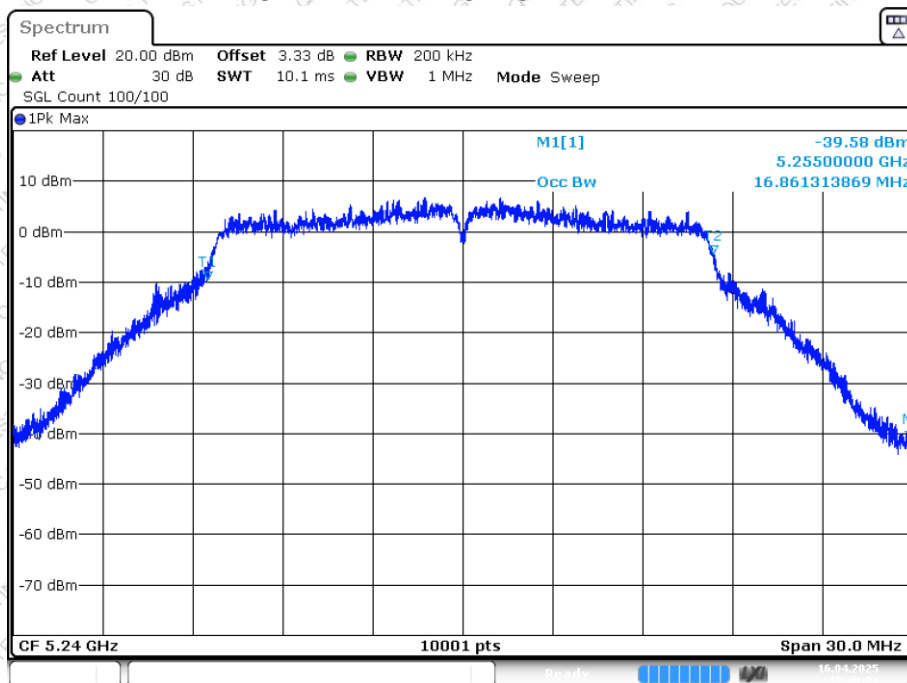

Date: 16.APR.2025 17:48:21


OBW NVNT a 5260MHz Ant1

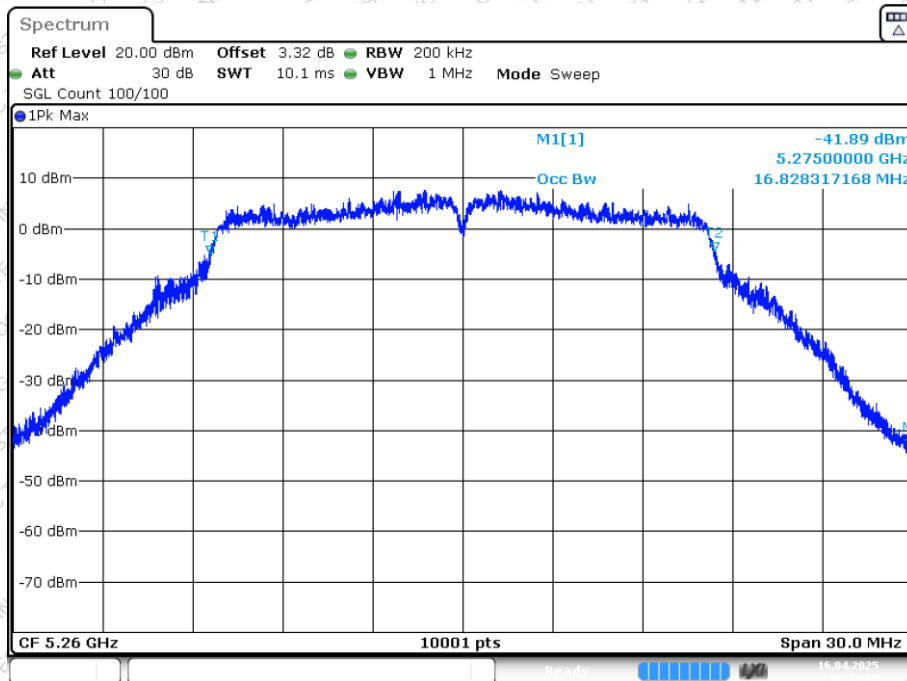

Date: 16.APR.2025 17:51:18




OBW NVNT a 5300MHz Ant1

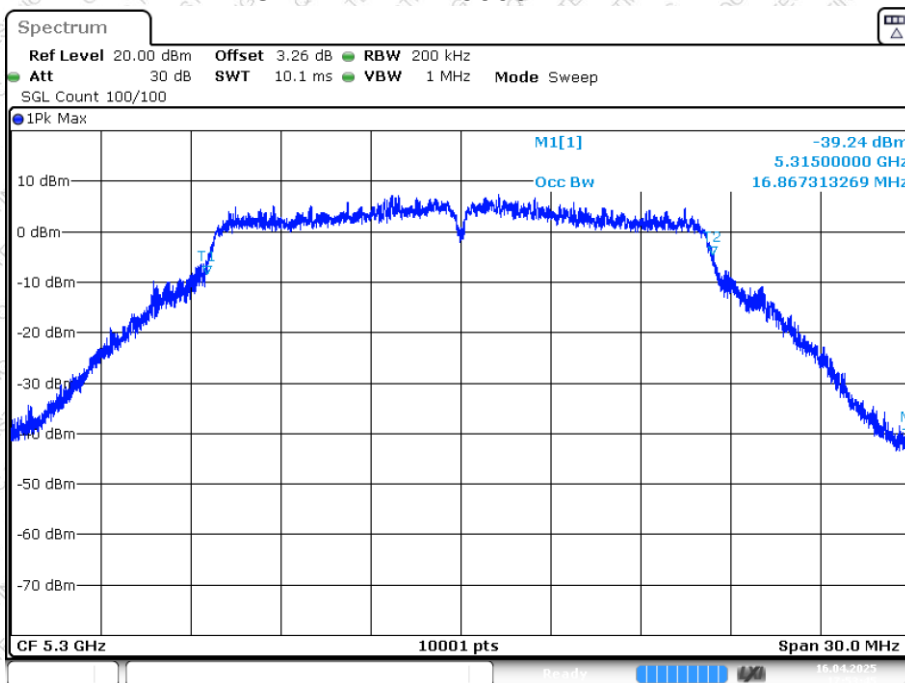

Date: 16.APR.2025 17:53:45


OBW NVNT a 5320MHz Ant1

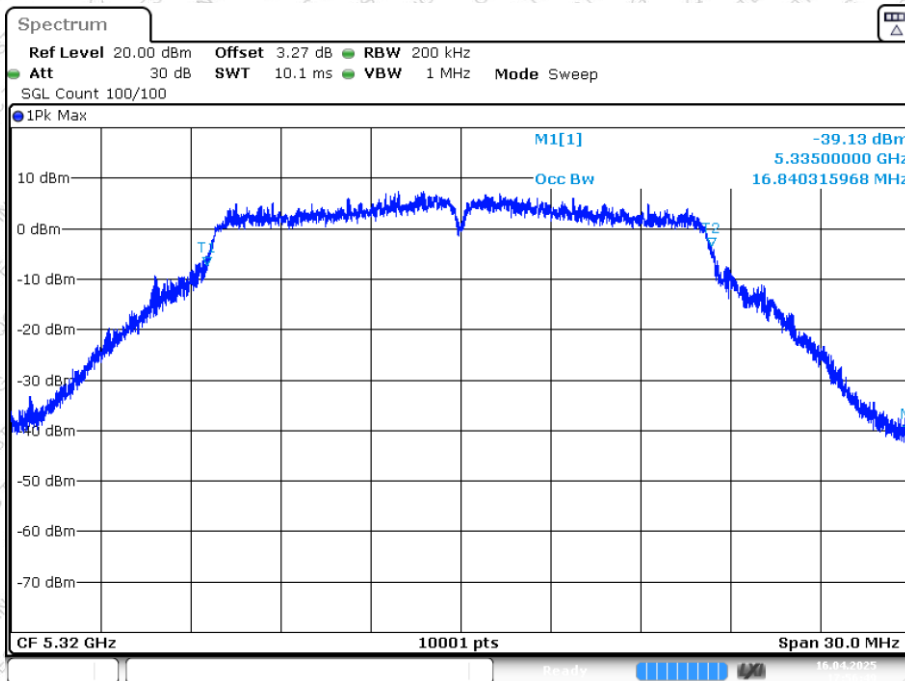

Date: 16.APR.2025 17:56:49




OBW NVNT a 5500MHz Ant1

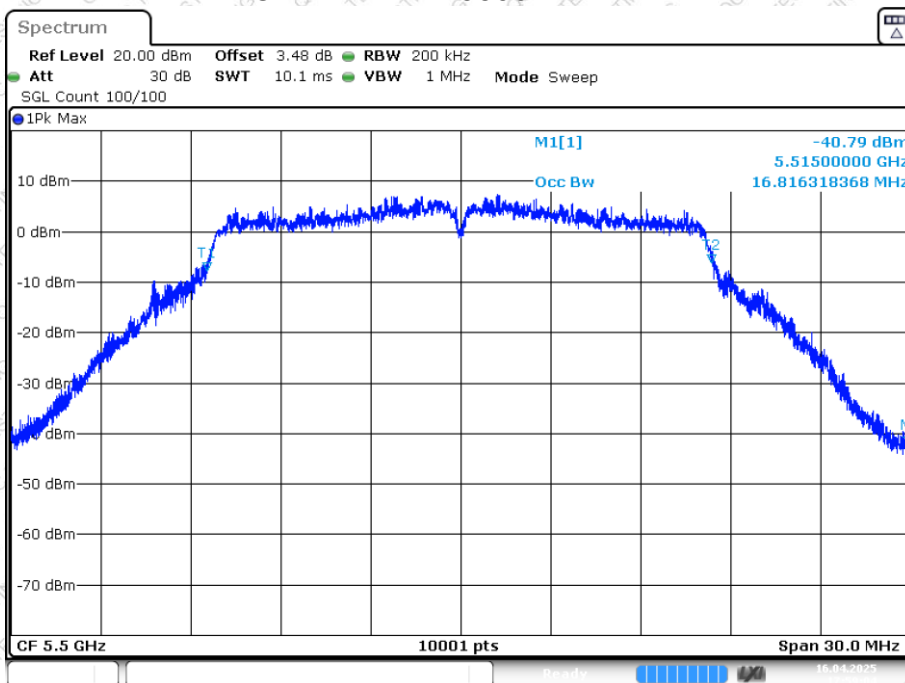

Date: 16.APR.2025 17:59:05


OBW NVNT a 5580MHz Ant1

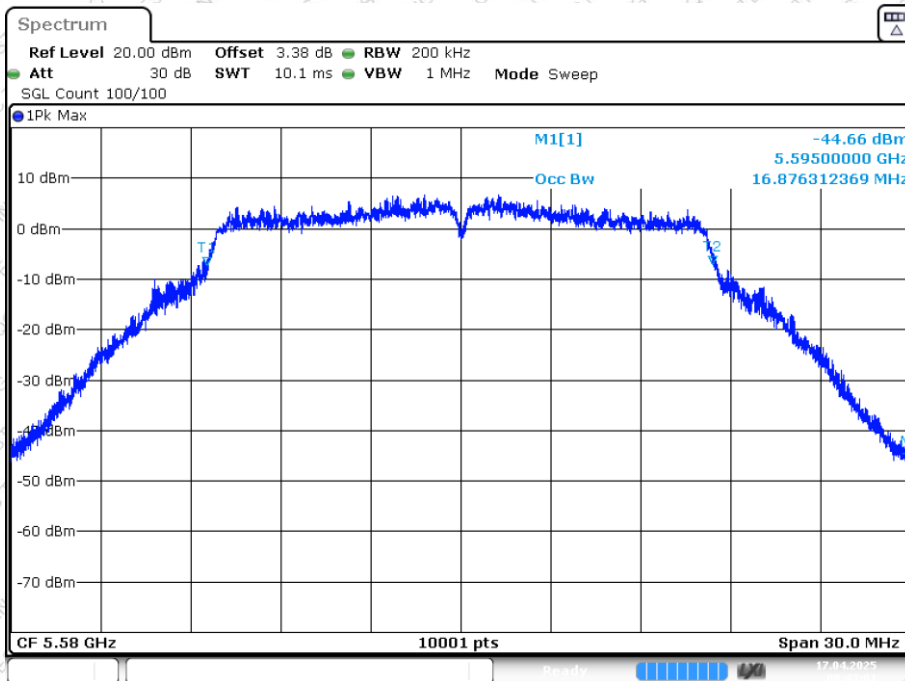

Date: 17.APR.2025 09:43:02




OBW NVNT a 5700MHz Ant1

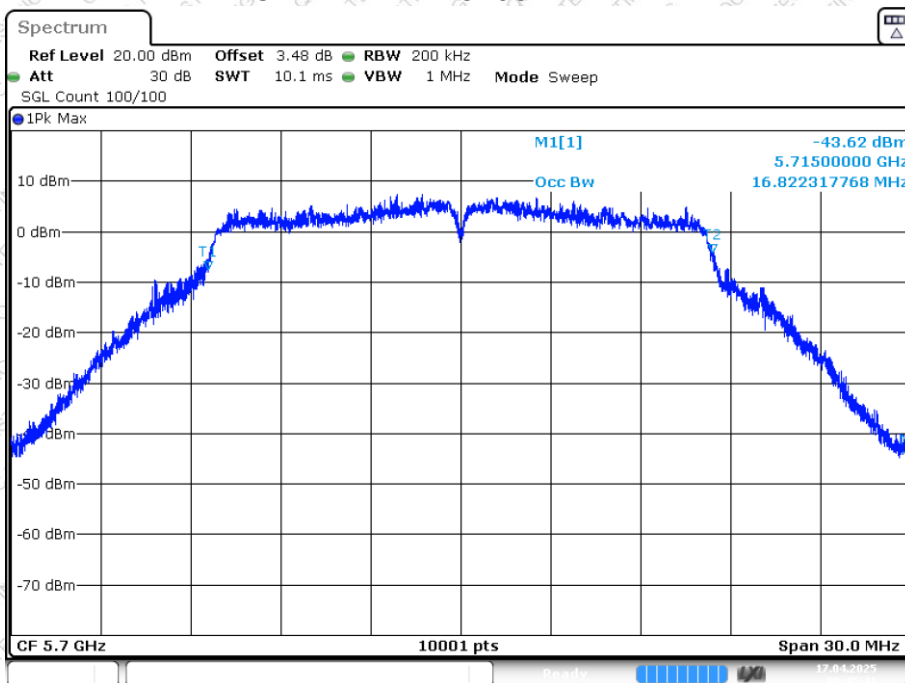

Date: 17. APR 2025 09:45:41


OBW NVNT a 5720MHz Ant1

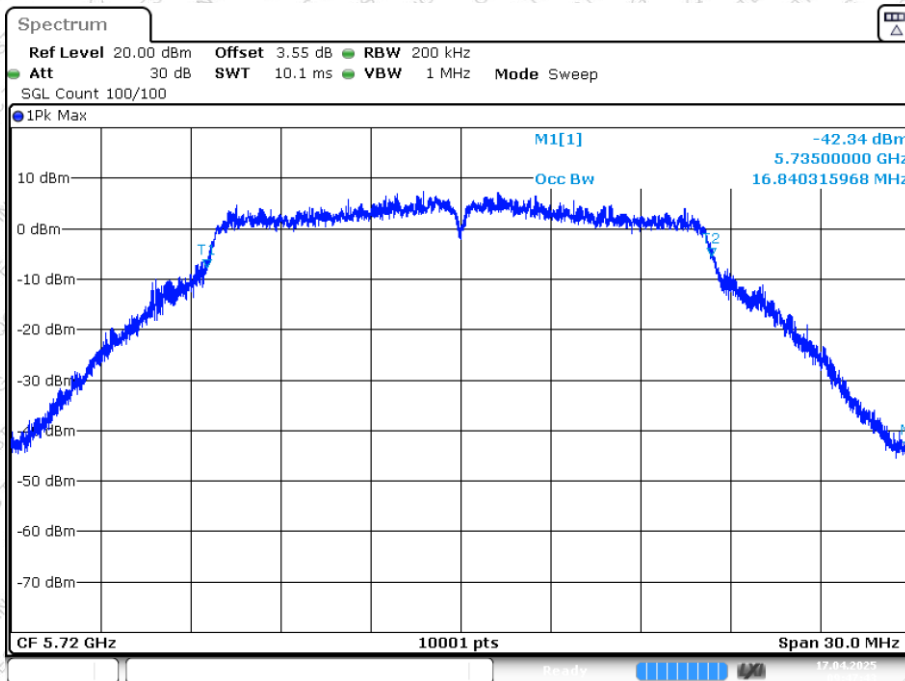

Date: 17. APR 2025 09:47:43




OBW NVNT a 5745MHz Ant1

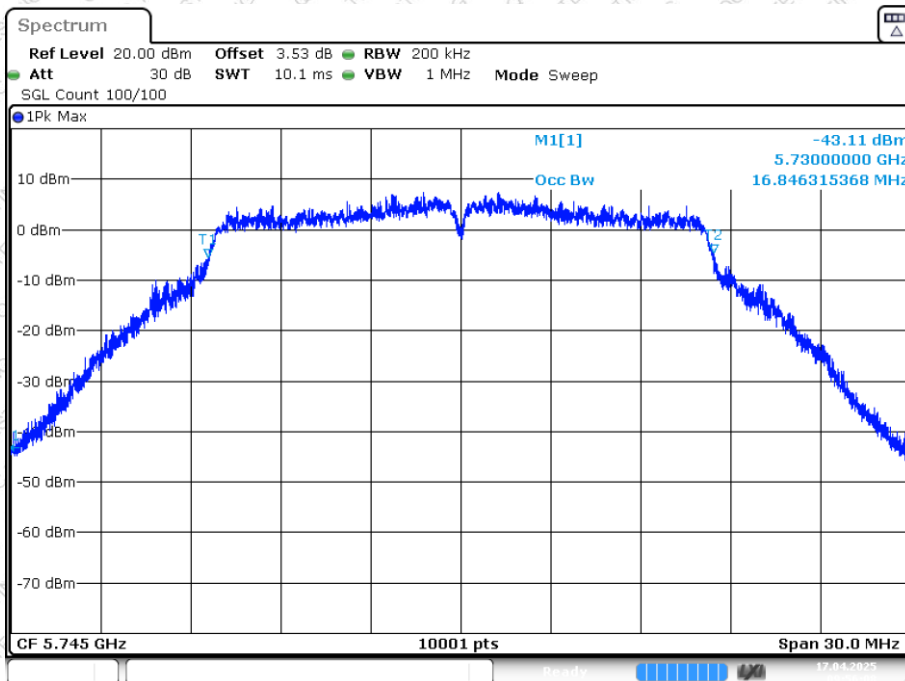

Date: 17. APR 2025 09:56:08


OBW NVNT a 5785MHz Ant1

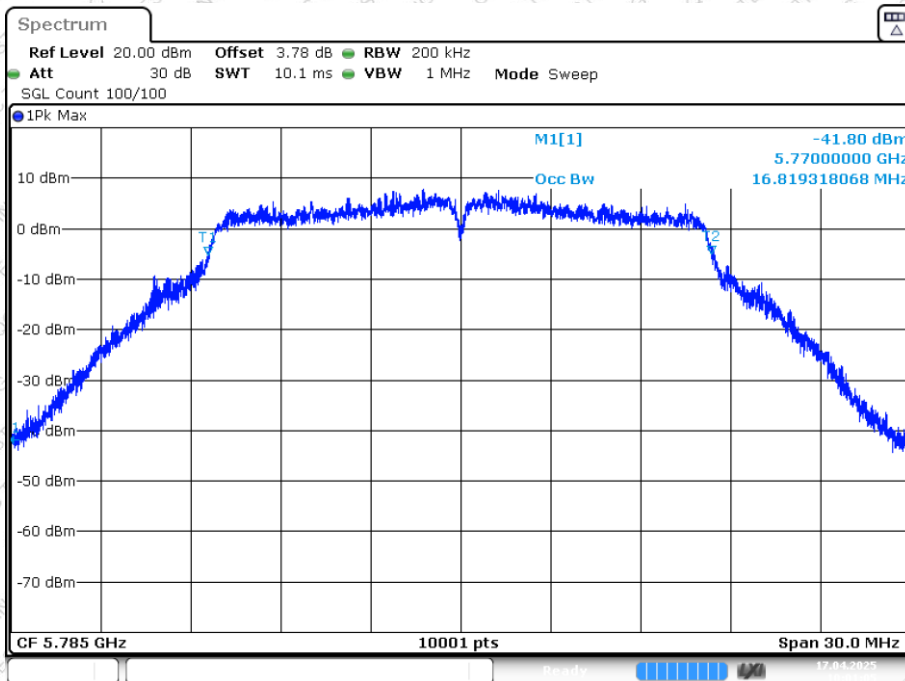

Date: 17. APR 2025 10:01:05




OBW NVNT a 5825MHz Ant1

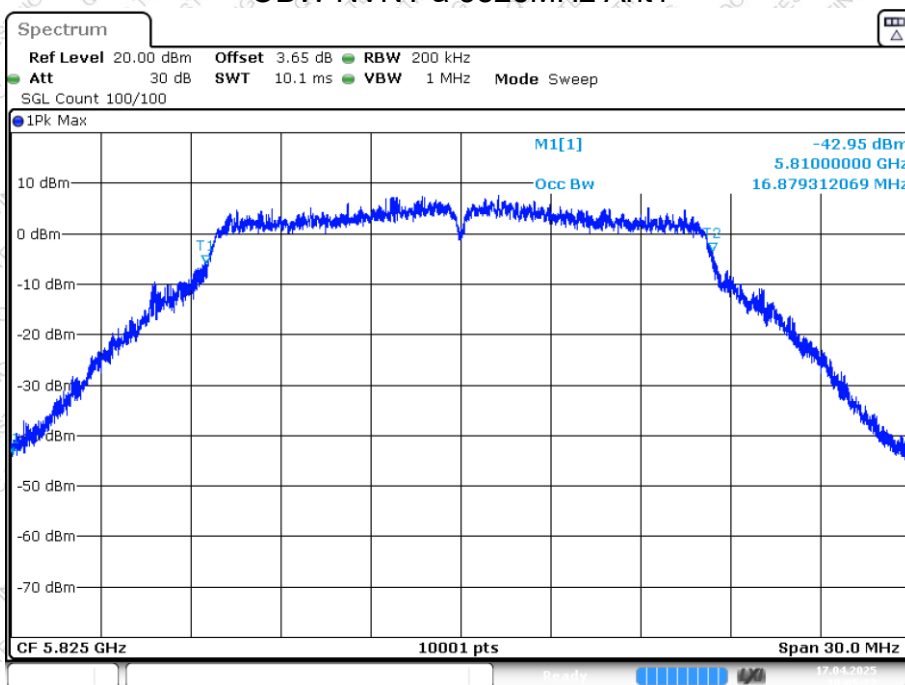

Date: 17. APR 2025 10:05:23


OBW NVNT n20 5180MHz Ant1

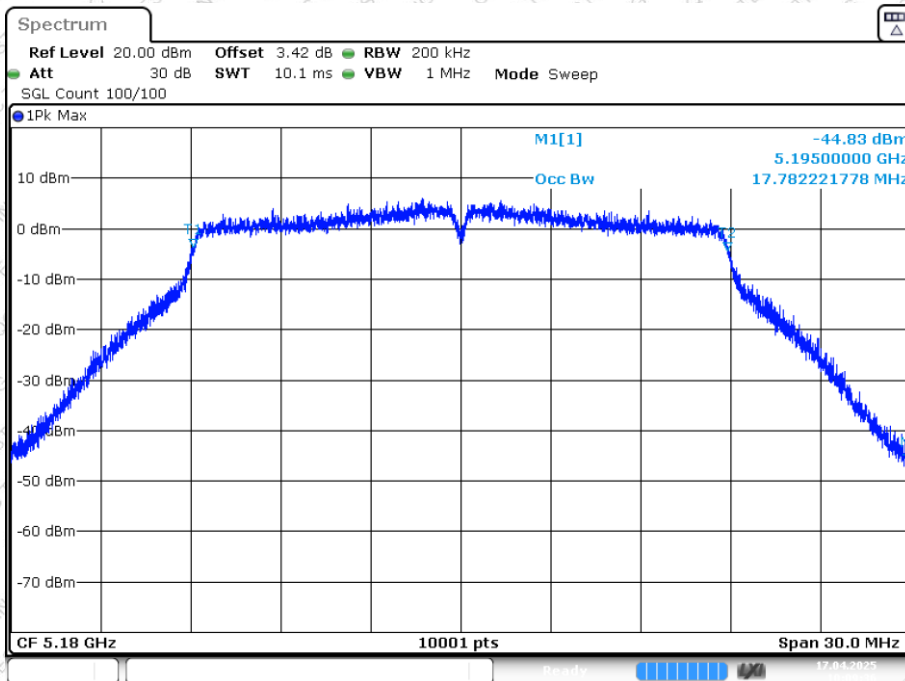

Date: 17. APR 2025 10:09:36




OBW NVNT n20 5200MHz Ant1

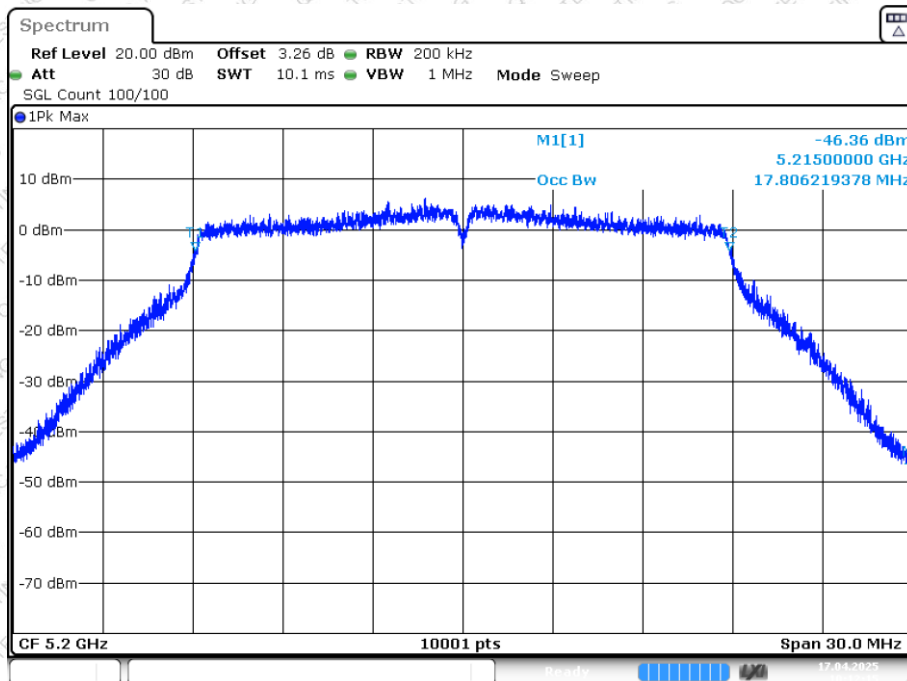

Date: 17. APR 2025 10:12:15


OBW NVNT n20 5240MHz Ant1

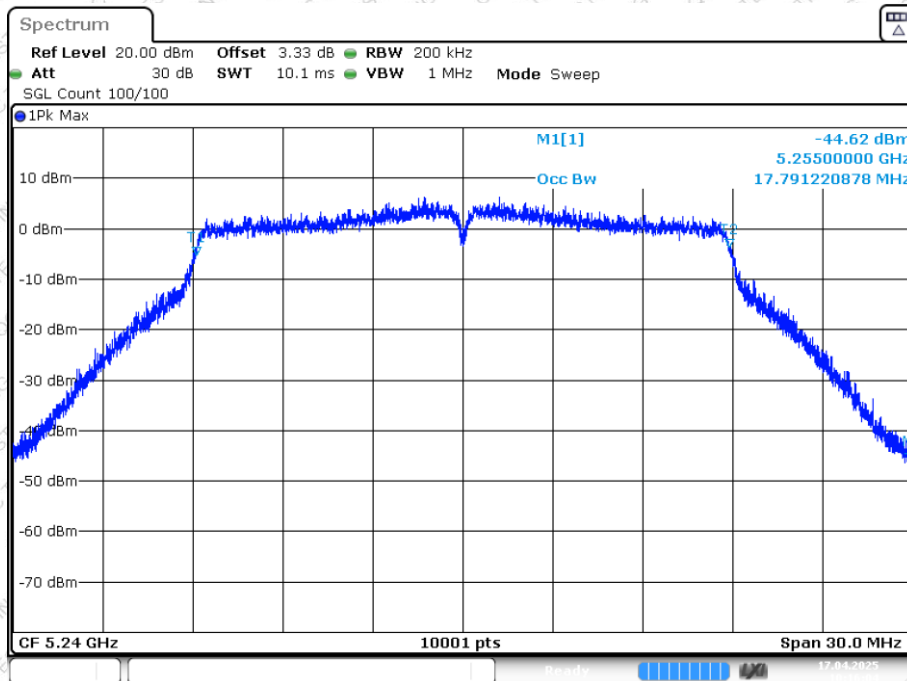

Date: 17. APR 2025 10:16:05




OBW NVNT n20 5260MHz Ant1

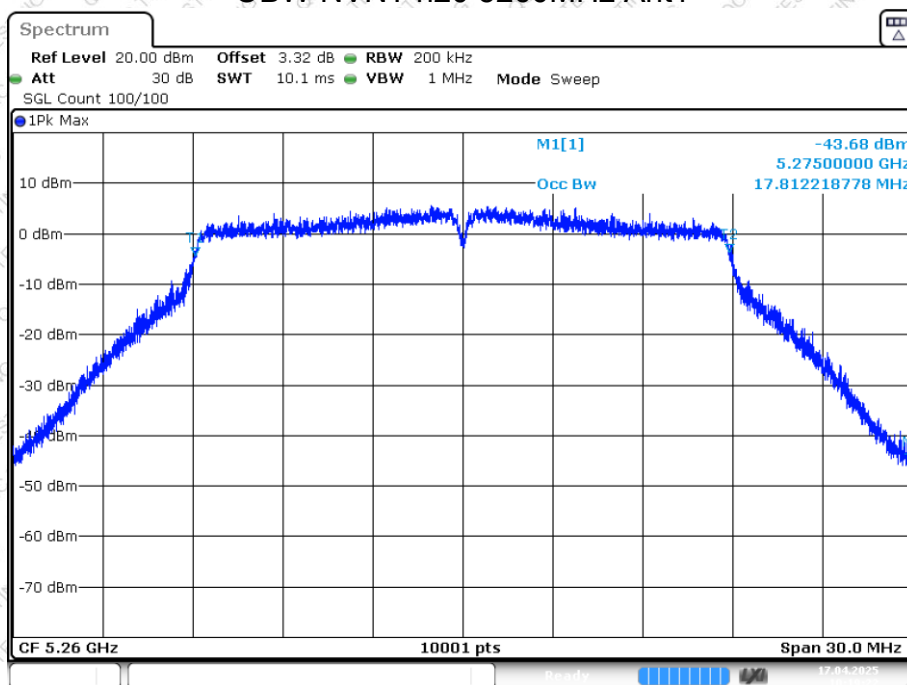

Date: 17. APR 2025 10:19:22


OBW NVNT n20 5300MHz Ant1

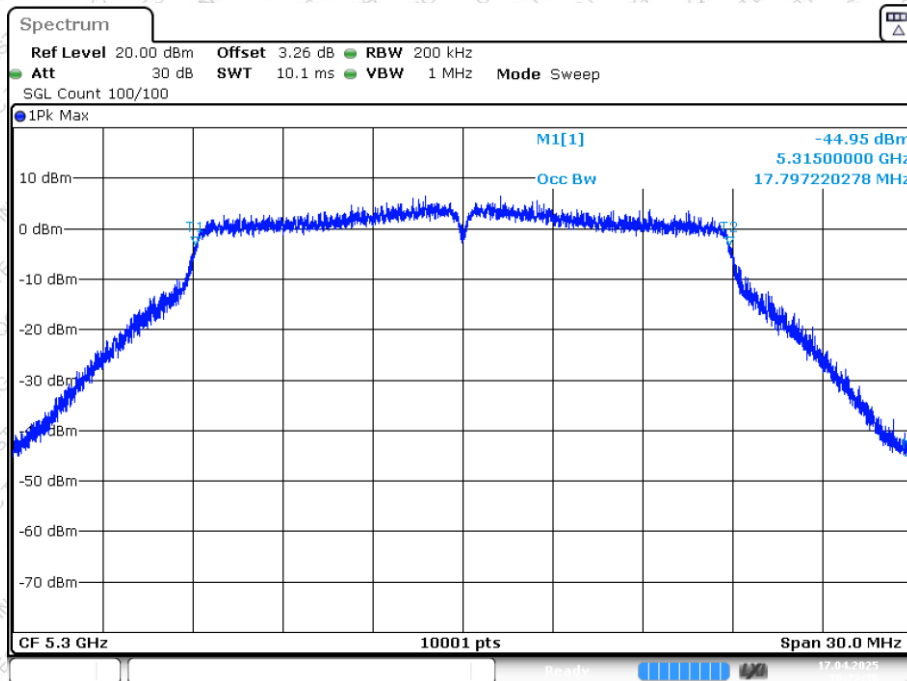

Date: 17. APR 2025 10:22:36




OBW NVNT n20 5320MHz Ant1

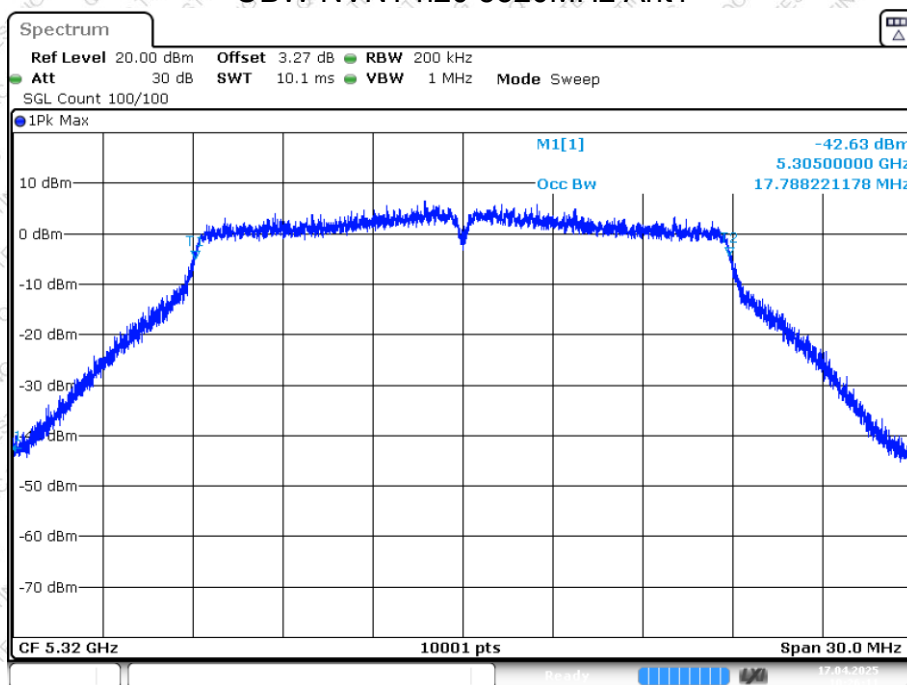


Date: 17. APR 2025 10:26:11

OBW NVNT n20 5500MHz Ant1

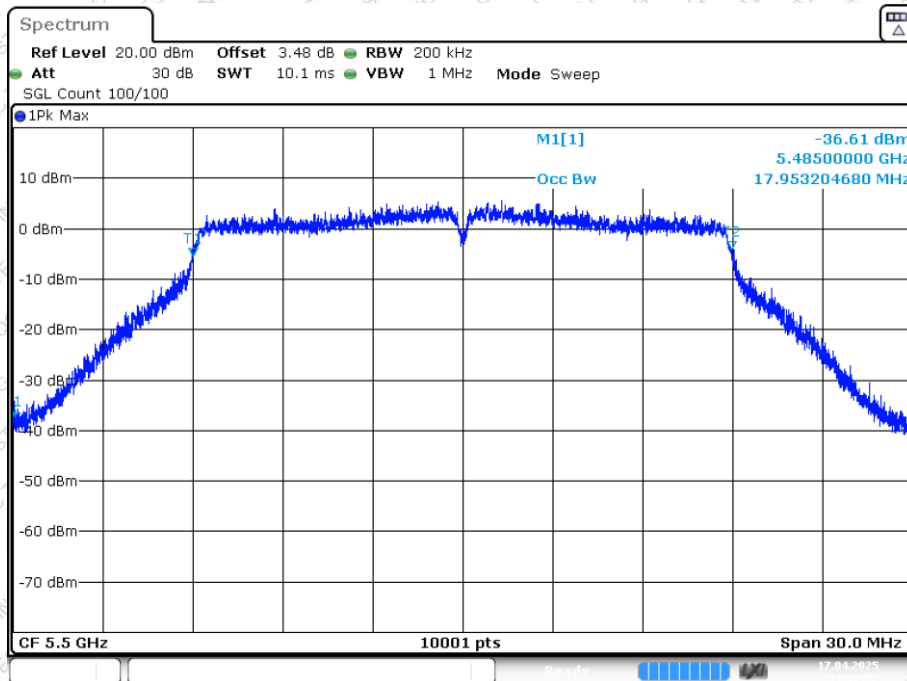


Date: 17. APR 2025 11:12:53

OBW NVNT n20 5580MHz Ant1

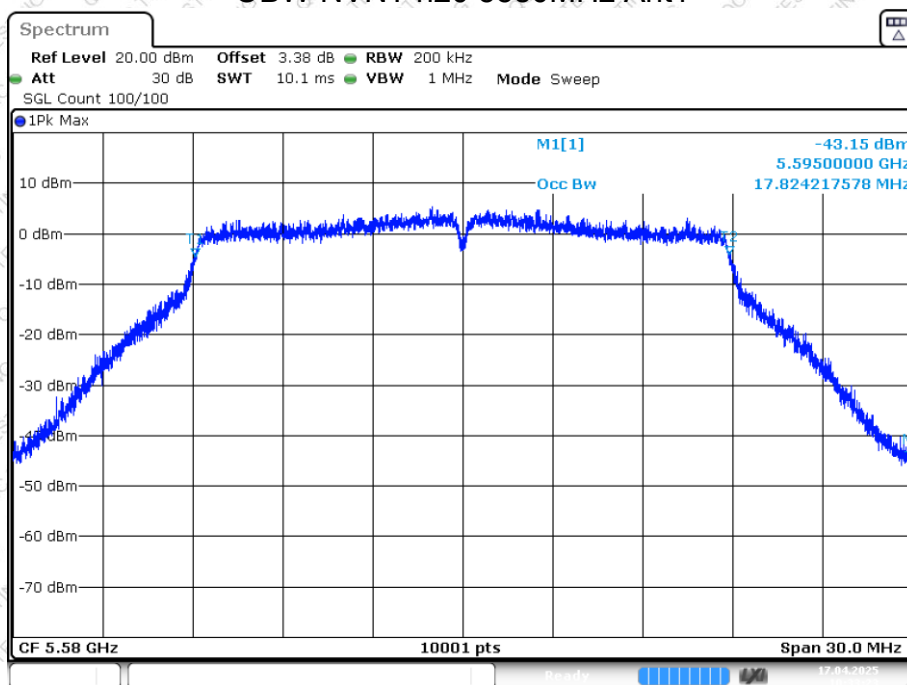

Date: 17.APR.2025 10:33:23

OBW NVNT n20 5700MHz Ant1

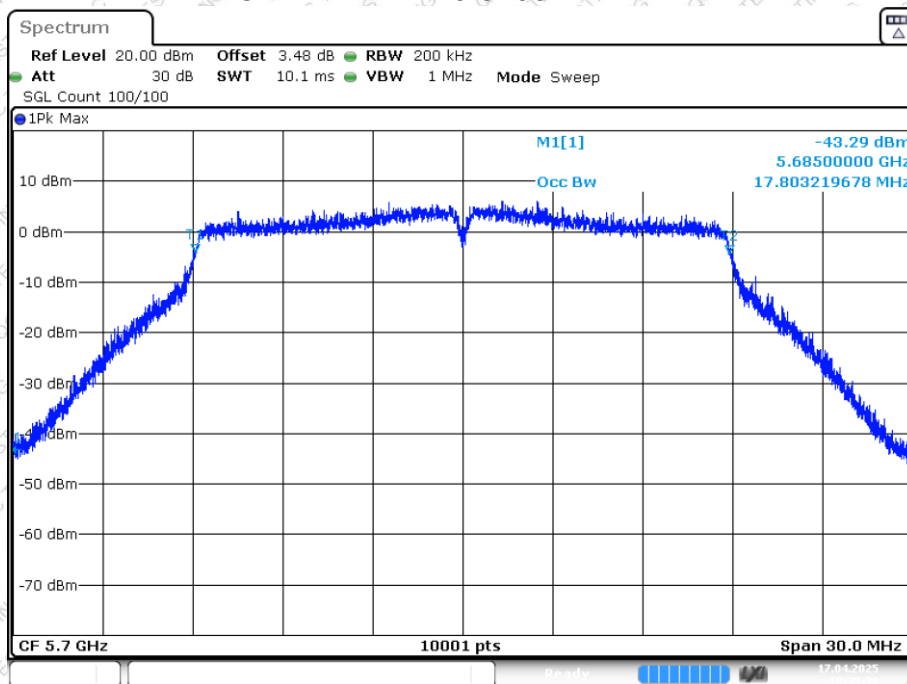

Date: 17.APR.2025 10:35:31