




Test Graphs

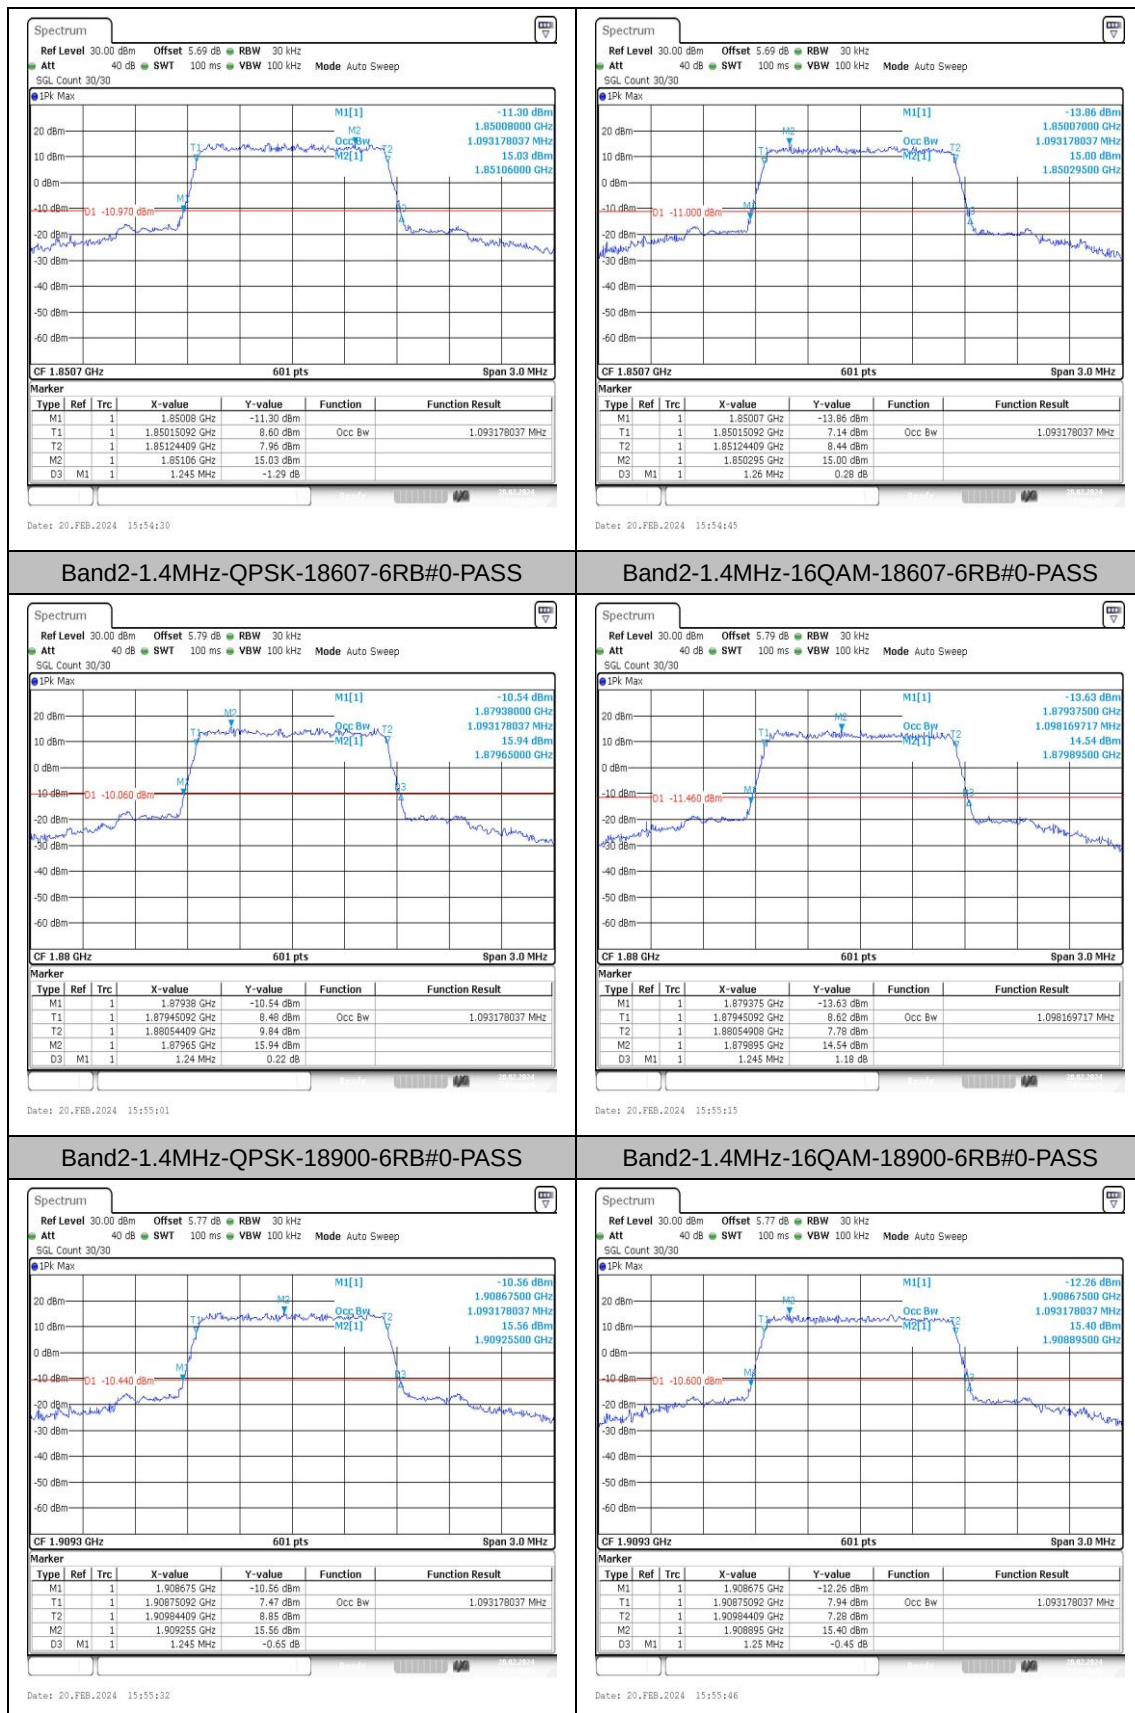



Waltek Testing Group (Shenzhen) Co., Ltd.


<http://www.waltek.com.cn>

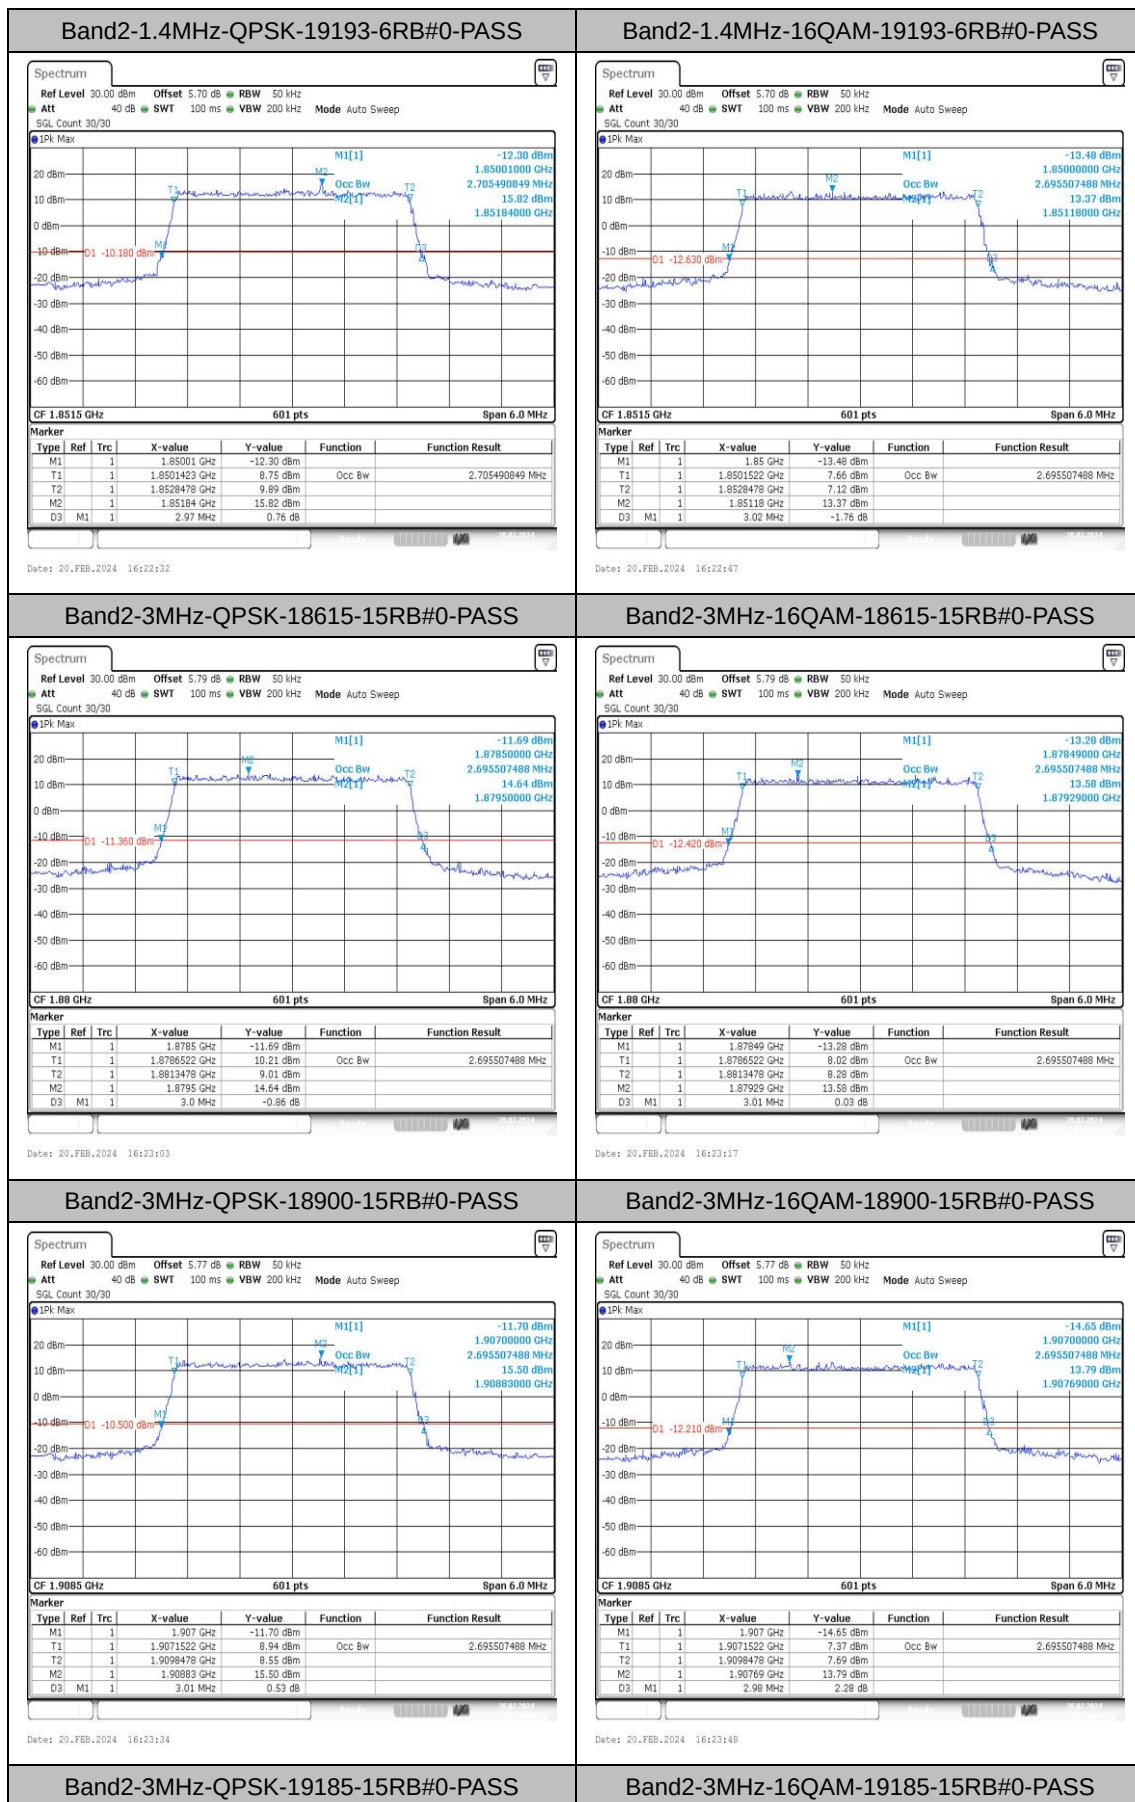

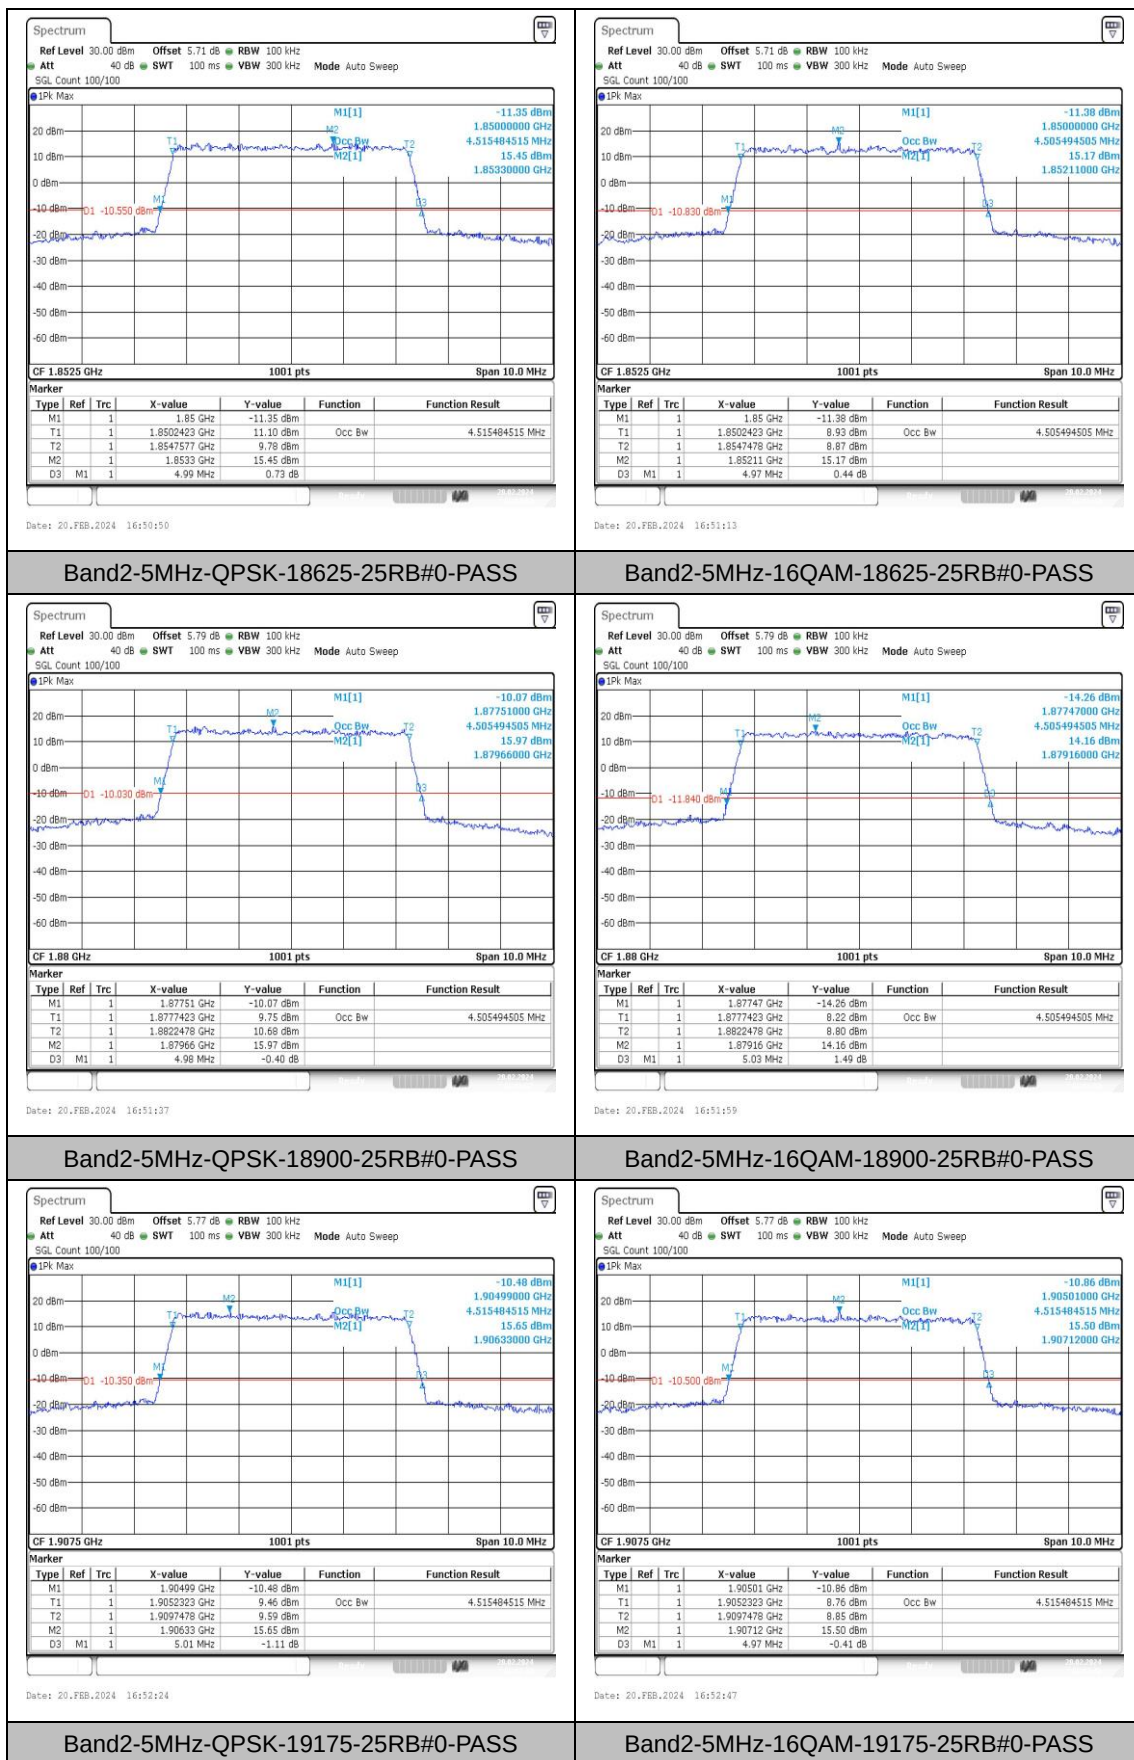

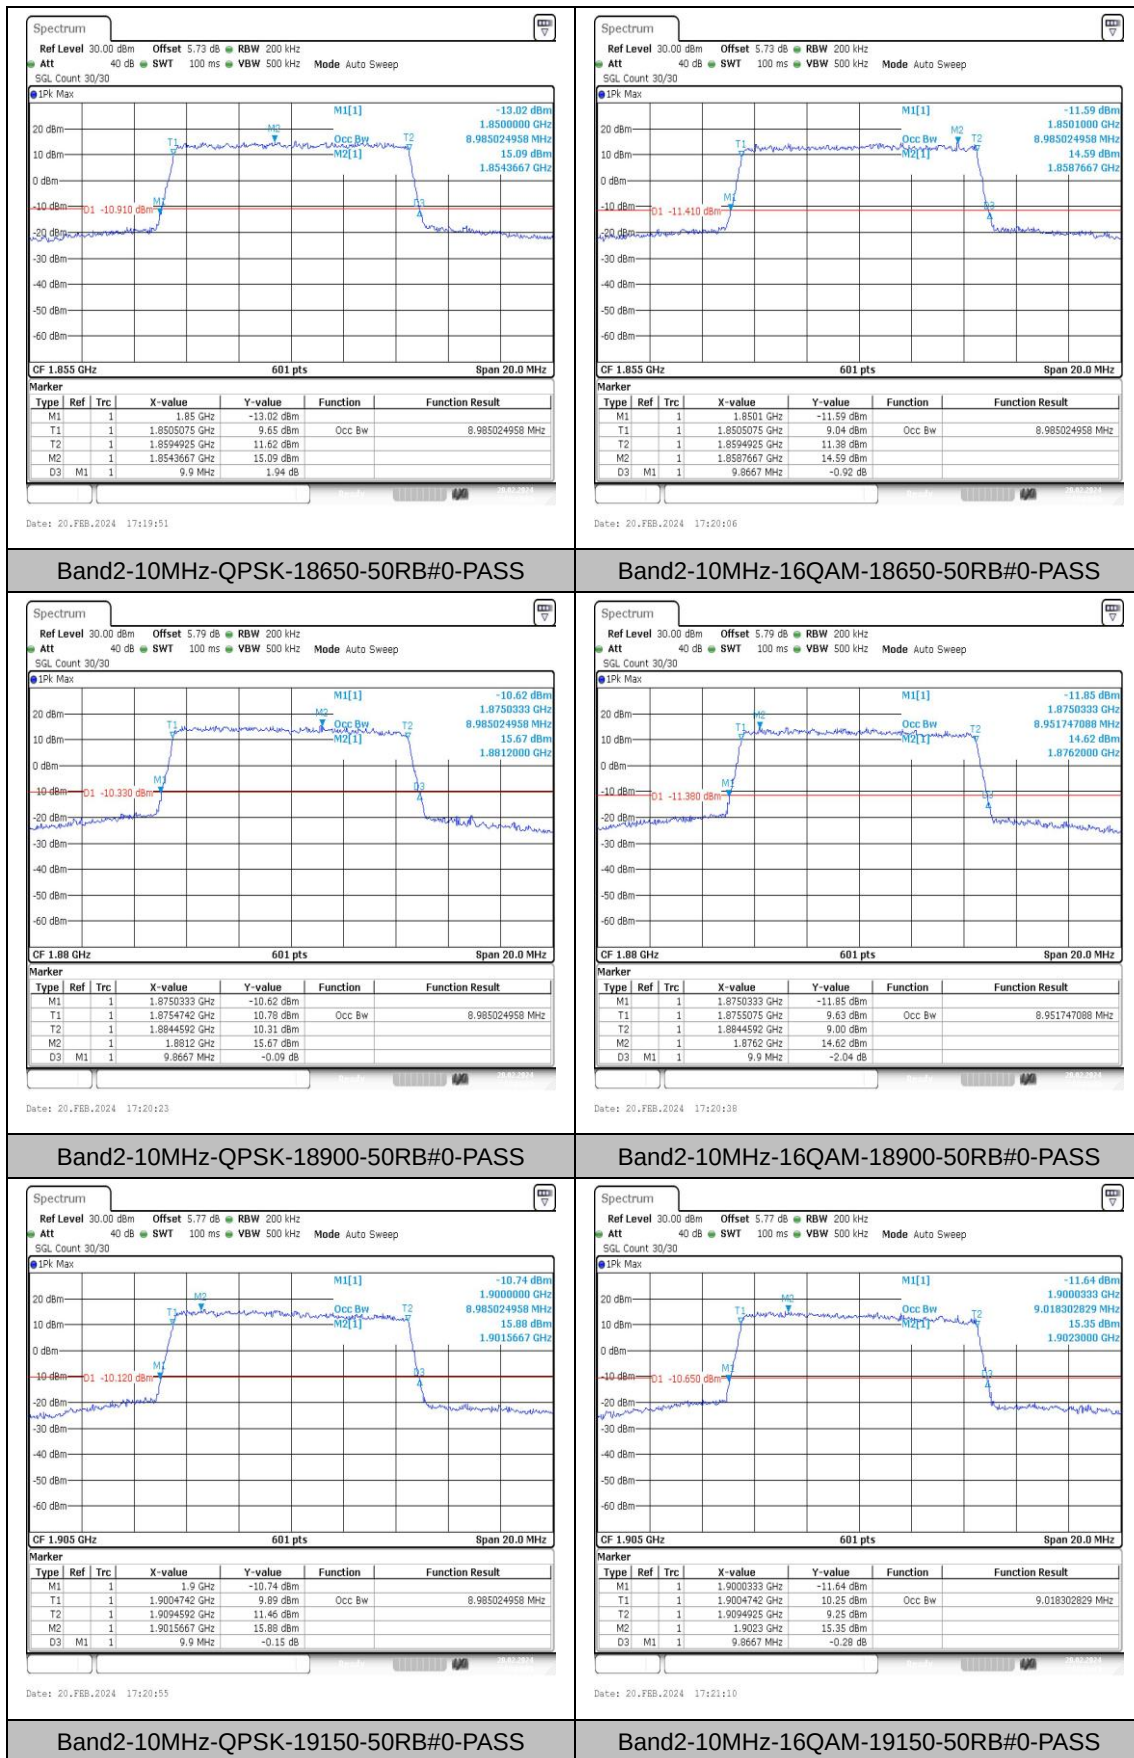

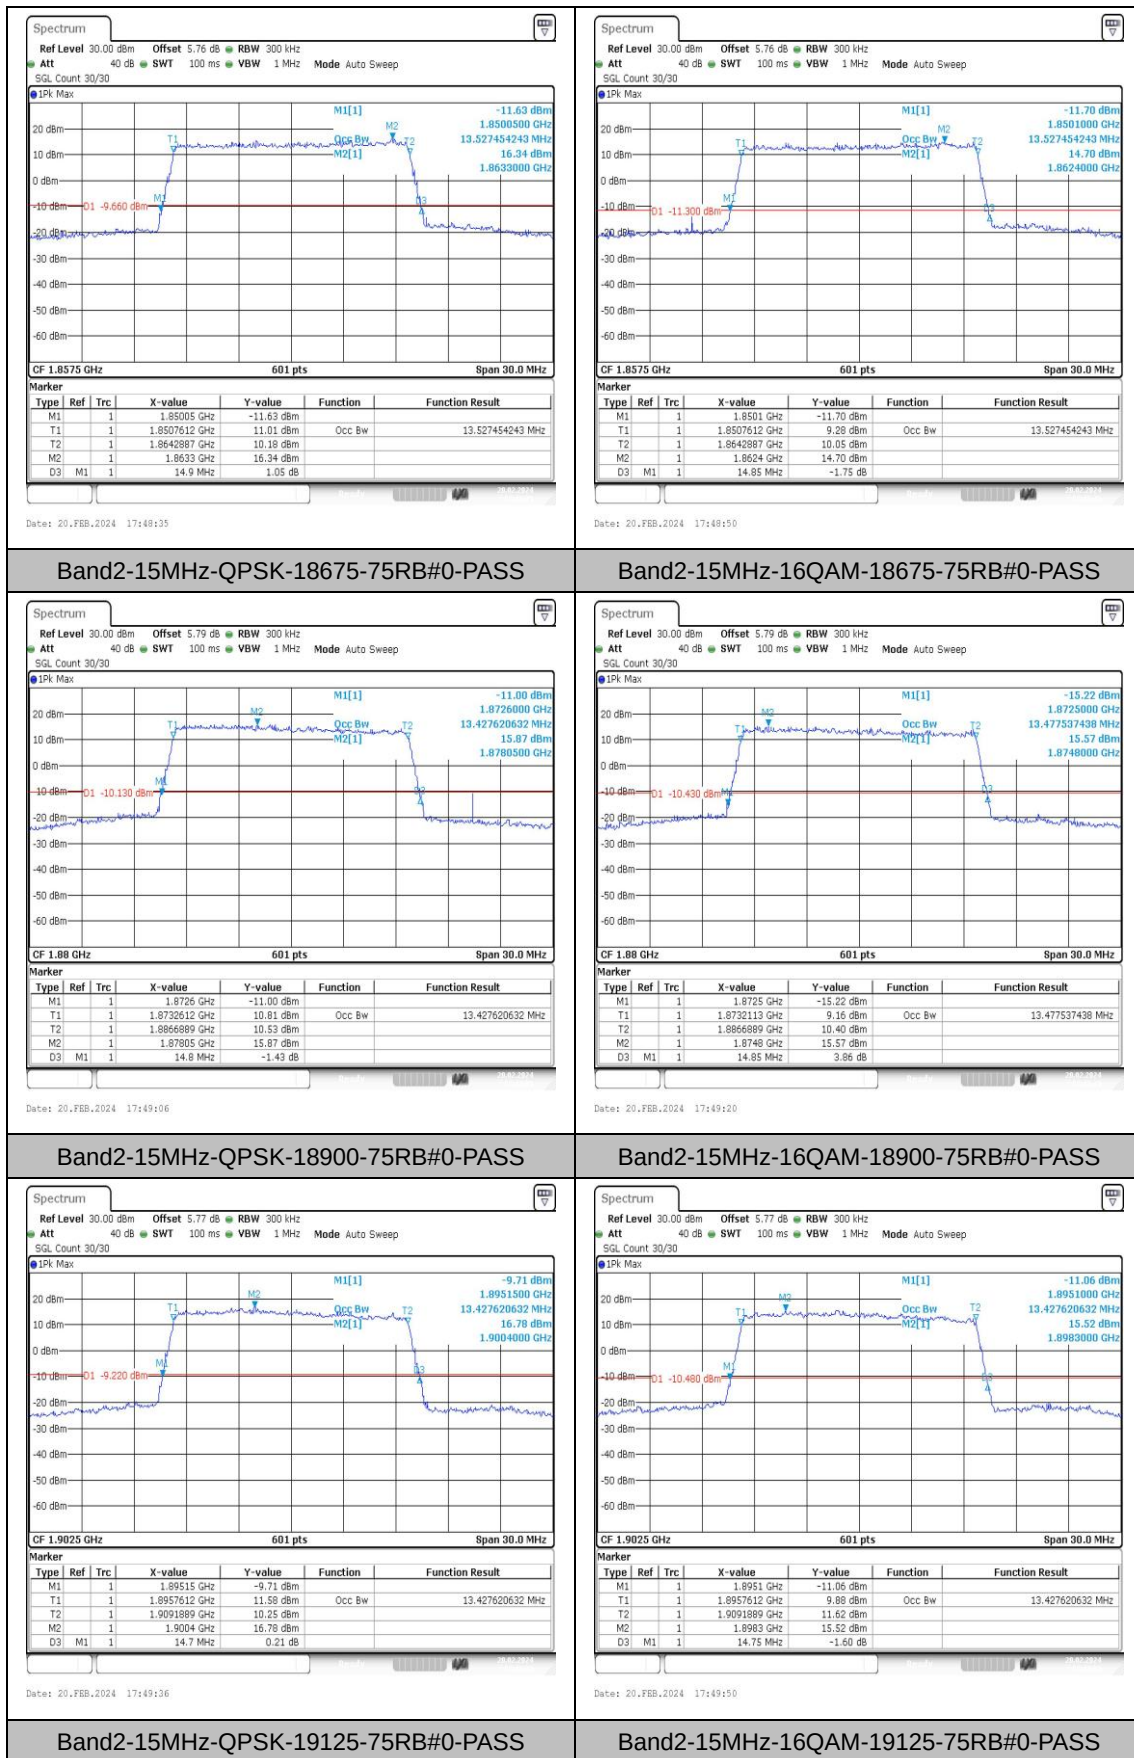

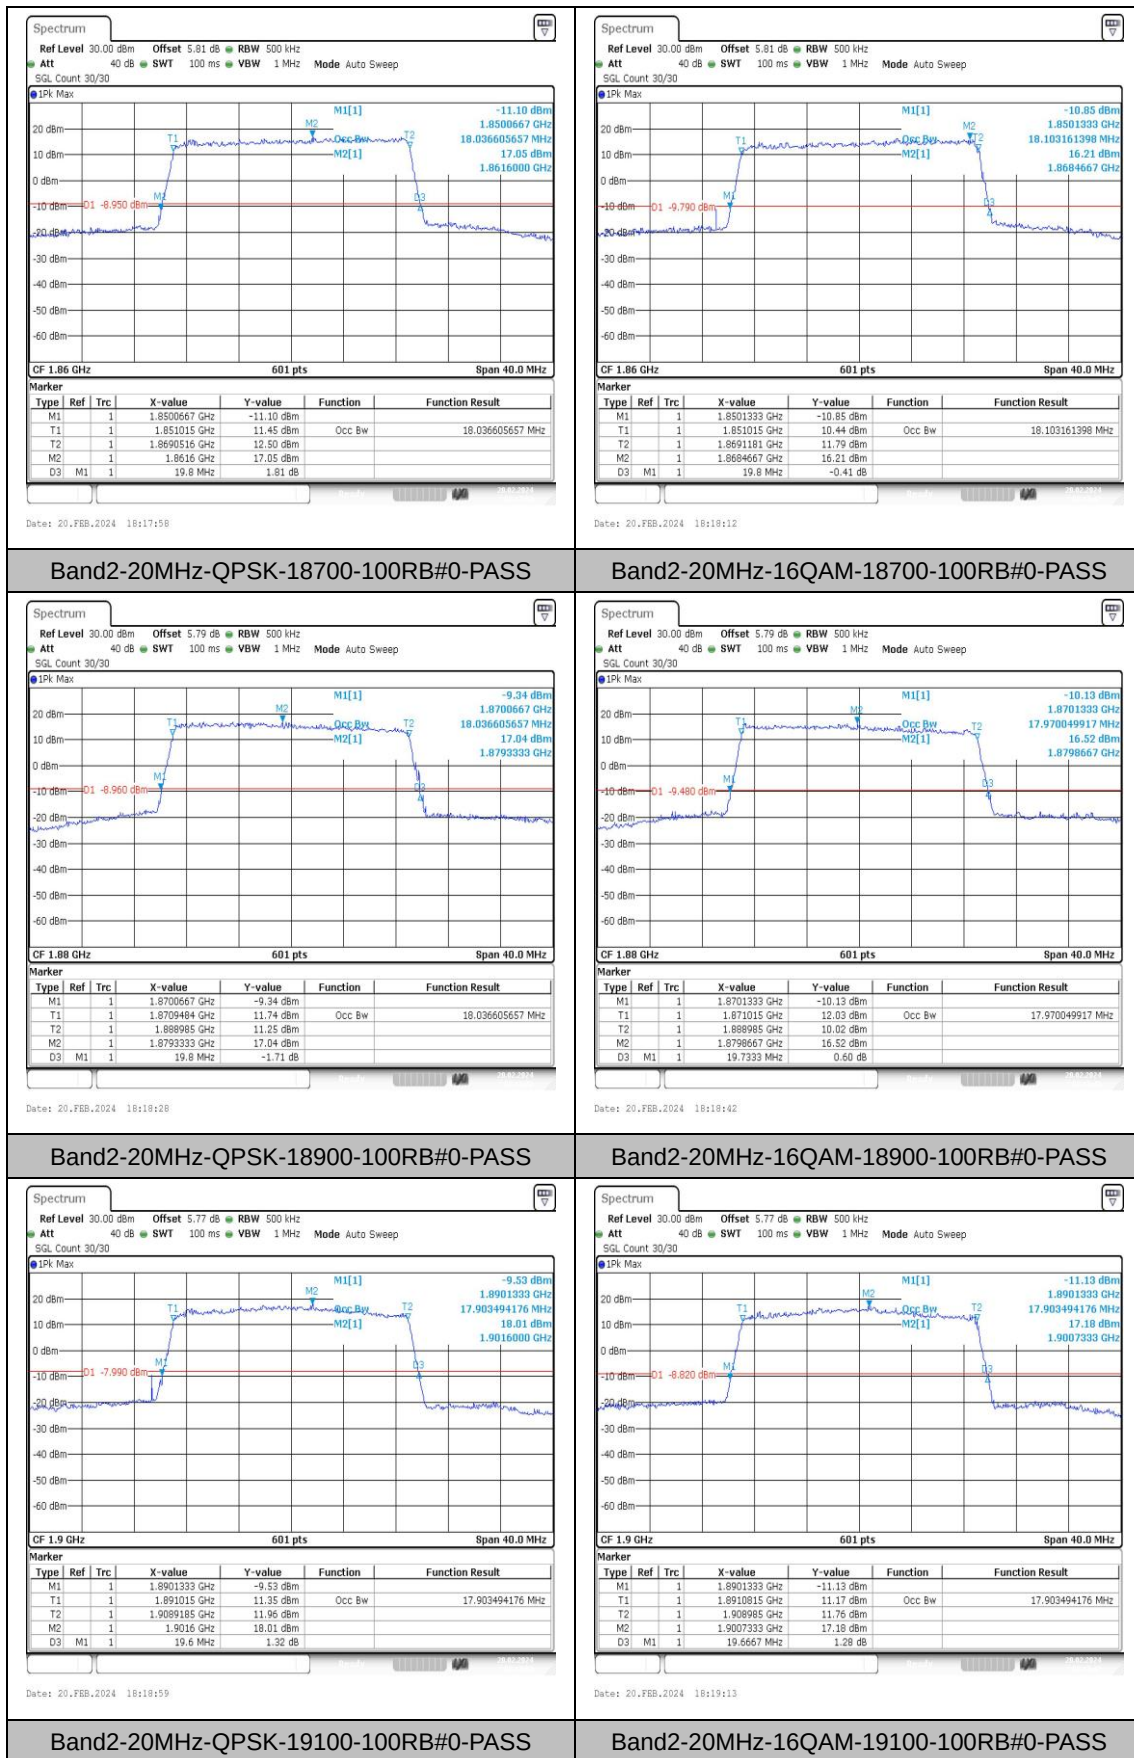


Appendix D: Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1RB#0	-29.84	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	-31.61	PASS
Band2	1.4MHz	QPSK	18607	1RB#5	-38.66	PASS
Band2	1.4MHz	16QAM	18607	1RB#5	-39.42	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	-21.71	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	-23.54	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	-32.95	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	-33.98	PASS
Band2	1.4MHz	QPSK	19193	1RB#5	-27.74	PASS
Band2	1.4MHz	16QAM	19193	1RB#5	-29.78	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	-21.09	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	-22.68	PASS
Band2	3MHz	QPSK	18615	1RB#0	-21.02	PASS
Band2	3MHz	16QAM	18615	1RB#0	-22.73	PASS
Band2	3MHz	QPSK	18615	1RB#14	-37.34	PASS
Band2	3MHz	16QAM	18615	1RB#14	-38.25	PASS
Band2	3MHz	QPSK	18615	15RB#0	-18.54	PASS
Band2	3MHz	16QAM	18615	15RB#0	-18.61	PASS
Band2	3MHz	QPSK	19185	1RB#0	-39.98	PASS
Band2	3MHz	16QAM	19185	1RB#0	-39.94	PASS
Band2	3MHz	QPSK	19185	1RB#14	-20.28	PASS
Band2	3MHz	16QAM	19185	1RB#14	-23.22	PASS
Band2	3MHz	QPSK	19185	15RB#0	-18.63	PASS
Band2	3MHz	16QAM	19185	15RB#0	-18.70	PASS
Band2	5MHz	QPSK	18625	1RB#0	-25.68	PASS
Band2	5MHz	16QAM	18625	1RB#0	-27.43	PASS
Band2	5MHz	QPSK	18625	1RB#24	-43.32	PASS
Band2	5MHz	16QAM	18625	1RB#24	-43.30	PASS
Band2	5MHz	QPSK	18625	25RB#0	-19.65	PASS
Band2	5MHz	16QAM	18625	25RB#0	-19.53	PASS
Band2	5MHz	QPSK	19175	1RB#0	-43.48	PASS
Band2	5MHz	16QAM	19175	1RB#0	-43.57	PASS
Band2	5MHz	QPSK	19175	1RB#24	-25.09	PASS
Band2	5MHz	16QAM	19175	1RB#24	-26.79	PASS
Band2	5MHz	QPSK	19175	25RB#0	-20.04	PASS

Band2	5MHz	16QAM	19175	25RB#0	-20.25	PASS
Band2	10MHz	QPSK	18650	1RB#0	-34.03	PASS
Band2	10MHz	16QAM	18650	1RB#0	-34.98	PASS
Band2	10MHz	QPSK	18650	1RB#49	-43.84	PASS
Band2	10MHz	16QAM	18650	1RB#49	-43.36	PASS
Band2	10MHz	QPSK	18650	50RB#0	-21.72	PASS
Band2	10MHz	16QAM	18650	50RB#0	-21.91	PASS
Band2	10MHz	QPSK	19150	1RB#0	-44.38	PASS
Band2	10MHz	16QAM	19150	1RB#0	-44.18	PASS
Band2	10MHz	QPSK	19150	1RB#49	-28.85	PASS
Band2	10MHz	16QAM	19150	1RB#49	-29.51	PASS
Band2	10MHz	QPSK	19150	50RB#0	-24.12	PASS
Band2	10MHz	16QAM	19150	50RB#0	-24.42	PASS
Band2	15MHz	QPSK	18675	1RB#0	-32.75	PASS
Band2	15MHz	16QAM	18675	1RB#0	-34.25	PASS
Band2	15MHz	QPSK	18675	1RB#74	-41.14	PASS
Band2	15MHz	16QAM	18675	1RB#74	-41.64	PASS
Band2	15MHz	QPSK	18675	75RB#0	-23.01	PASS
Band2	15MHz	16QAM	18675	75RB#0	-23.26	PASS
Band2	15MHz	QPSK	19125	1RB#0	-42.52	PASS
Band2	15MHz	16QAM	19125	1RB#0	-42.21	PASS
Band2	15MHz	QPSK	19125	1RB#74	-26.80	PASS
Band2	15MHz	16QAM	19125	1RB#74	-29.45	PASS
Band2	15MHz	QPSK	19125	75RB#0	-26.61	PASS
Band2	15MHz	16QAM	19125	75RB#0	-26.54	PASS
Band2	20MHz	QPSK	18700	1RB#0	-31.19	PASS
Band2	20MHz	16QAM	18700	1RB#0	-32.00	PASS
Band2	20MHz	QPSK	18700	1RB#99	-40.20	PASS
Band2	20MHz	16QAM	18700	1RB#99	-43.22	PASS
Band2	20MHz	QPSK	18700	100RB#0	-24.35	PASS
Band2	20MHz	16QAM	18700	100RB#0	-24.79	PASS
Band2	20MHz	QPSK	19100	1RB#0	-41.32	PASS
Band2	20MHz	16QAM	19100	1RB#0	-38.36	PASS
Band2	20MHz	QPSK	19100	1RB#99	-27.61	PASS
Band2	20MHz	16QAM	19100	1RB#99	-28.57	PASS
Band2	20MHz	QPSK	19100	100RB#0	-28.09	PASS
Band2	20MHz	16QAM	19100	100RB#0	-28.10	PASS

Test Graphs

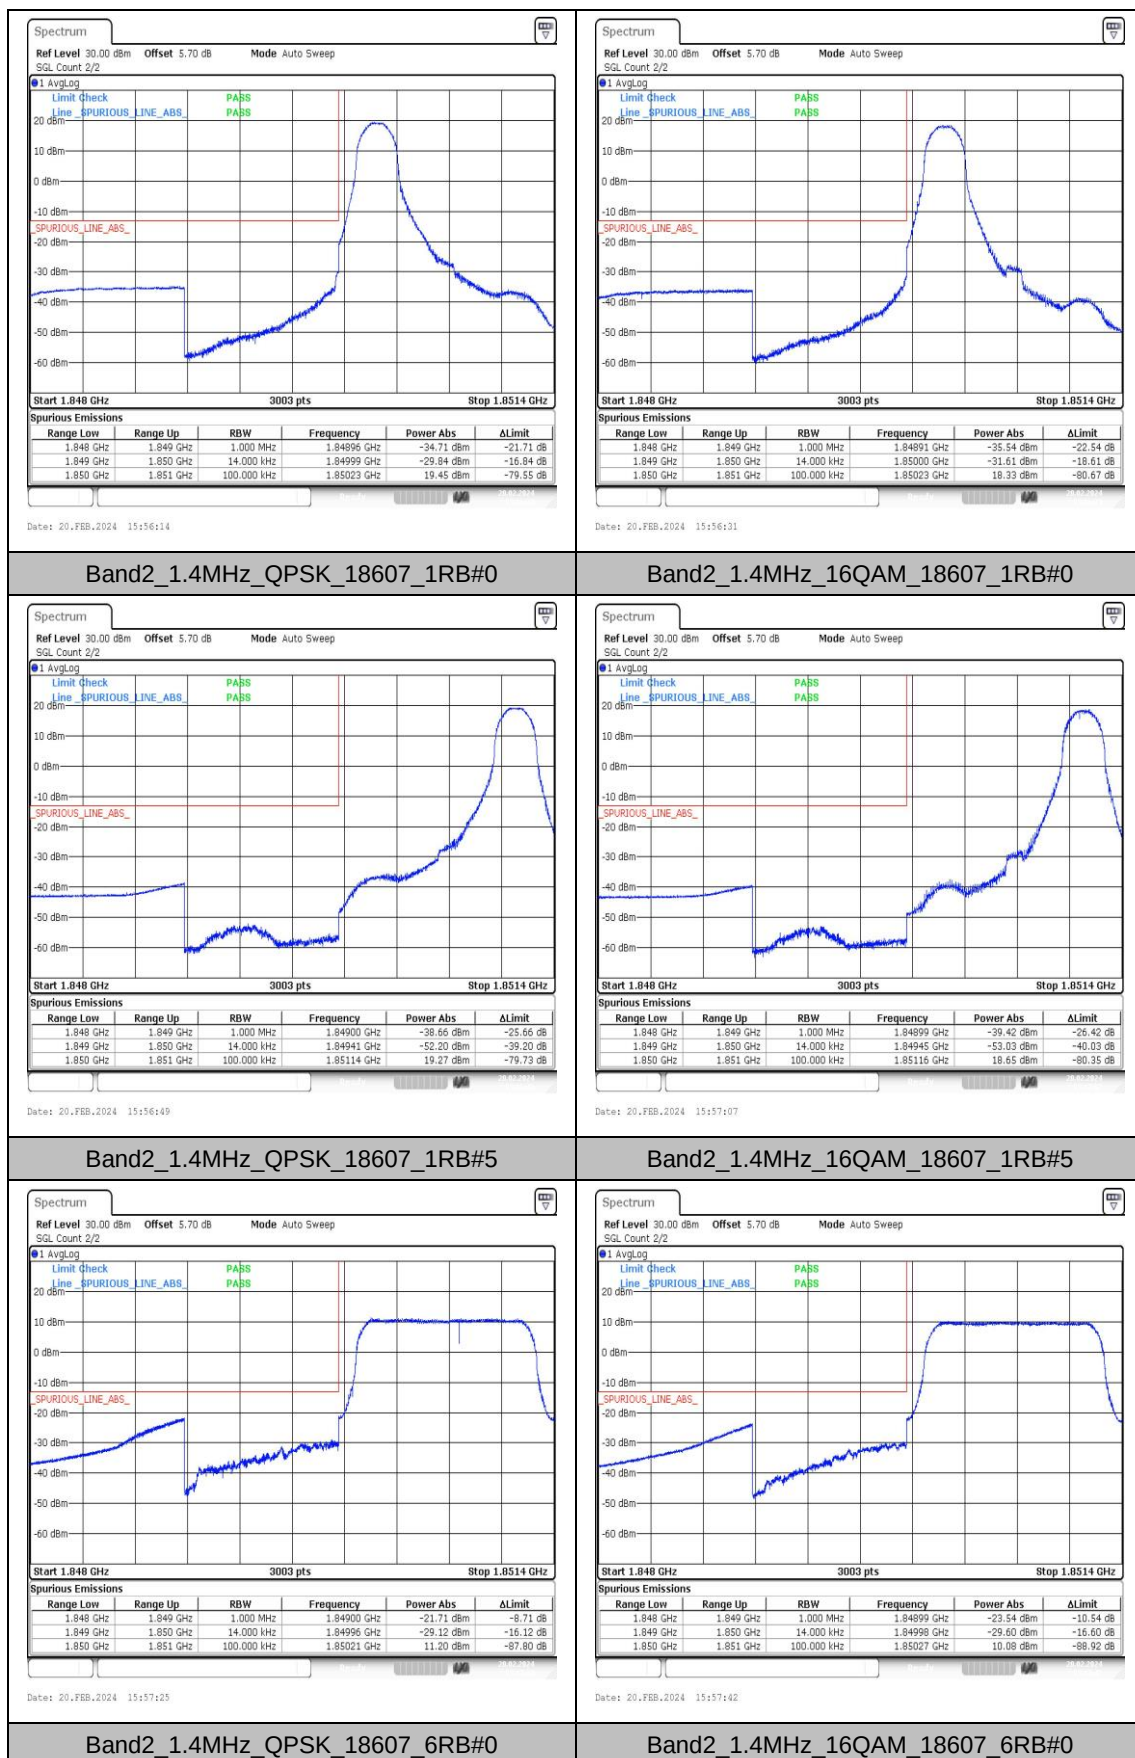

Waltek Testing Group (Shenzhen) Co., Ltd.

<http://www.waltek.com.cn>

