

Appendix Test Data

Report No.:	1812C50417812504-01	Test Sample No.:	1-2-2
Start Test Date:	2025-8-22	Finish Test Date:	2025-9-16
Test Engineer:	<i>dylan. Ma</i>	Auditor:	<i>Justin Feng</i>
Temperature:	22.9°C	Relative Humidity:	54%
Pressure:	101kPa		




Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	17.72	5171.24	5188.96	---	---
11A	Ant2	5180	17.60	5171.32	5188.92	---	---
11A	Ant1	5200	18.00	5190.96	5208.96	---	---
11A	Ant2	5200	18.16	5191.00	5209.16	---	---
11A	Ant1	5240	18.24	5230.96	5249.20	---	---
11A	Ant2	5240	18.16	5231.00	5249.16	---	---
11A	Ant1	5745	17.88	5736.00	5753.88	---	---
11A	Ant2	5745	18.00	5736.04	5754.04	---	---
11A	Ant1	5785	18.04	5775.96	5794.00	---	---
11A	Ant2	5785	17.88	5776.00	5793.88	---	---
11A	Ant1	5825	18.24	5815.96	5834.20	---	---
11A	Ant2	5825	18.12	5816.04	5834.16	---	---
11N20MIMO	Ant1	5180	18.64	5170.76	5189.40	---	---
11N20MIMO	Ant2	5180	18.60	5170.72	5189.32	---	---
11N20MIMO	Ant1	5200	18.80	5190.64	5209.44	---	---
11N20MIMO	Ant2	5200	18.72	5190.68	5209.40	---	---
11N20MIMO	Ant1	5240	18.68	5230.68	5249.36	---	---
11N20MIMO	Ant2	5240	18.64	5230.72	5249.36	---	---
11N20MIMO	Ant1	5745	18.76	5735.64	5754.40	---	---
11N20MIMO	Ant2	5745	18.68	5735.72	5754.40	---	---
11N20MIMO	Ant1	5785	18.72	5775.68	5794.40	---	---
11N20MIMO	Ant2	5785	18.76	5775.68	5794.44	---	---
11N20MIMO	Ant1	5825	18.52	5815.68	5834.20	---	---
11N20MIMO	Ant2	5825	18.64	5815.68	5834.32	---	---
11N40MIMO	Ant1	5190	38.40	5170.72	5209.12	---	---

11N40MIMO	Ant2	5190	38.08	5170.80	5208.88	---	---
11N40MIMO	Ant1	5230	38.16	5210.88	5249.04	---	---
11N40MIMO	Ant2	5230	38.40	5210.72	5249.12	---	---
11N40MIMO	Ant1	5755	38.24	5735.80	5774.04	---	---
11N40MIMO	Ant2	5755	38.32	5735.80	5774.12	---	---
11N40MIMO	Ant1	5795	38.24	5775.80	5814.04	---	---
11N40MIMO	Ant2	5795	38.08	5775.80	5813.88	---	---
11AC20MIMO	Ant1	5180	18.96	5170.52	5189.48	---	---
11AC20MIMO	Ant2	5180	19.04	5170.36	5189.40	---	---
11AC20MIMO	Ant1	5200	19.00	5190.52	5209.52	---	---
11AC20MIMO	Ant2	5200	19.08	5190.40	5209.48	---	---
11AC20MIMO	Ant1	5240	19.28	5230.28	5249.56	---	---
11AC20MIMO	Ant2	5240	19.20	5230.40	5249.60	---	---
11AC20MIMO	Ant1	5745	19.24	5735.32	5754.56	---	---
11AC20MIMO	Ant2	5745	19.08	5735.36	5754.44	---	---
11AC20MIMO	Ant1	5785	19.08	5775.36	5794.44	---	---
11AC20MIMO	Ant2	5785	19.00	5775.52	5794.52	---	---
11AC20MIMO	Ant1	5825	19.04	5815.44	5834.48	---	---
11AC20MIMO	Ant2	5825	18.92	5815.52	5834.44	---	---
11AC40MIMO	Ant1	5190	38.16	5170.96	5209.12	---	---
11AC40MIMO	Ant2	5190	38.24	5170.96	5209.20	---	---
11AC40MIMO	Ant1	5230	38.40	5210.72	5249.12	---	---
11AC40MIMO	Ant2	5230	38.32	5210.96	5249.28	---	---
11AC40MIMO	Ant1	5755	38.40	5735.80	5774.20	---	---
11AC40MIMO	Ant2	5755	38.48	5735.80	5774.28	---	---
11AC40MIMO	Ant1	5795	38.56	5775.80	5814.36	---	---
11AC40MIMO	Ant2	5795	38.32	5775.88	5814.20	---	---
11AC80MIMO	Ant1	5210	82.24	5168.72	5250.96	---	---
11AC80MIMO	Ant2	5210	83.84	5167.44	5251.28	---	---
11AC80MIMO	Ant1	5775	82.08	5735.00	5817.08	---	---
11AC80MIMO	Ant2	5775	84.96	5732.44	5817.40	---	---


Test Graphs

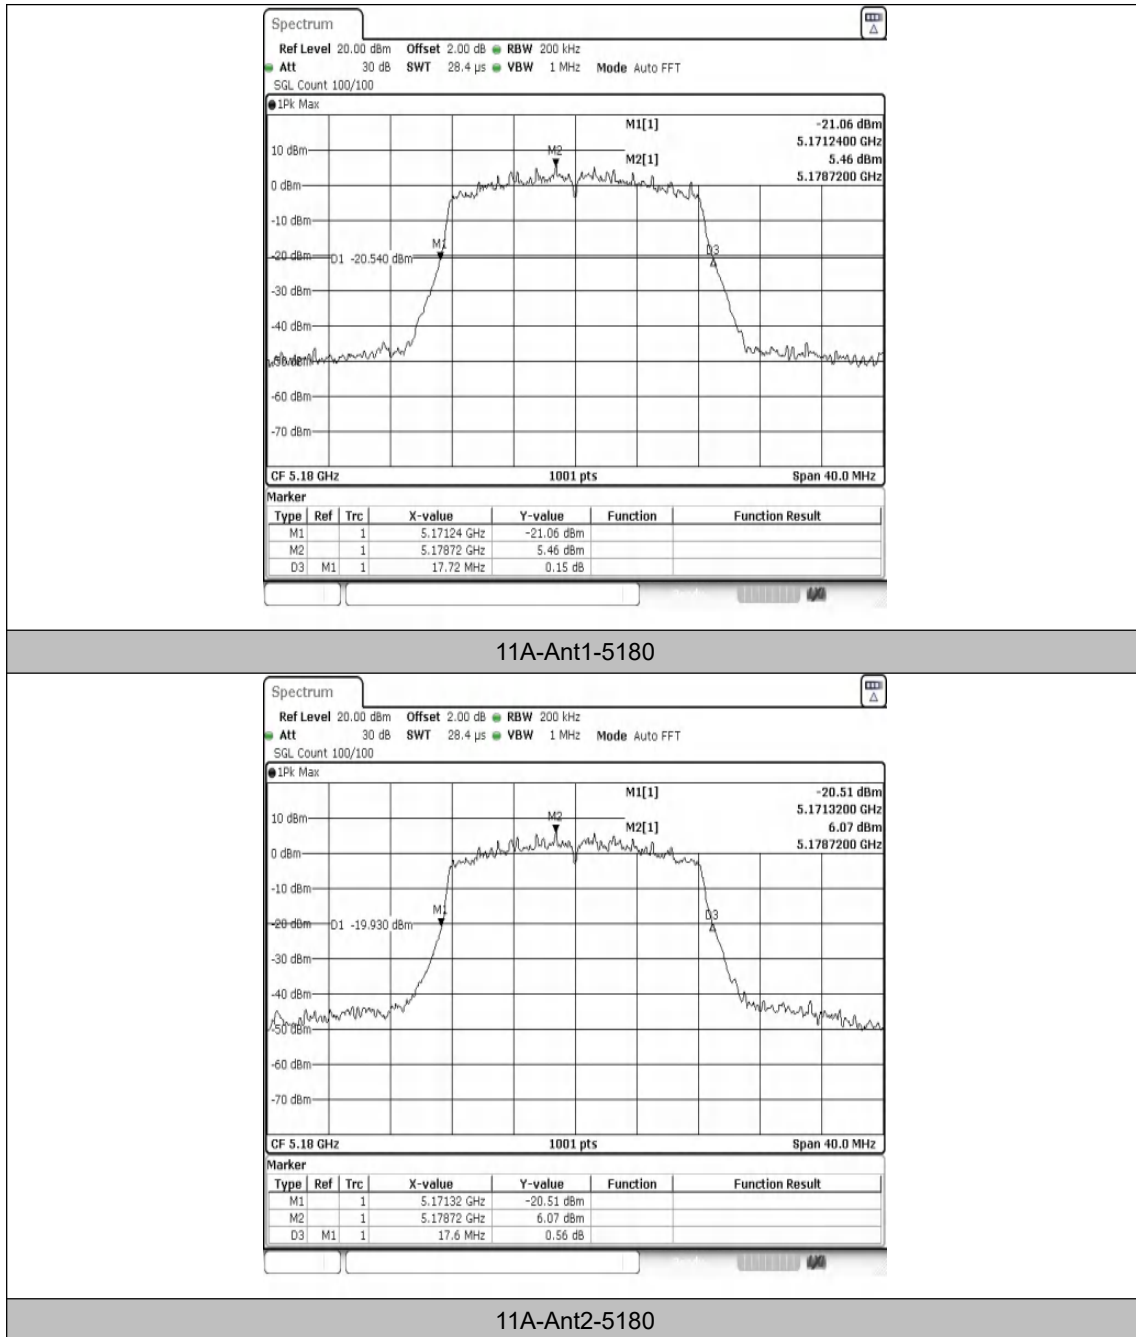


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

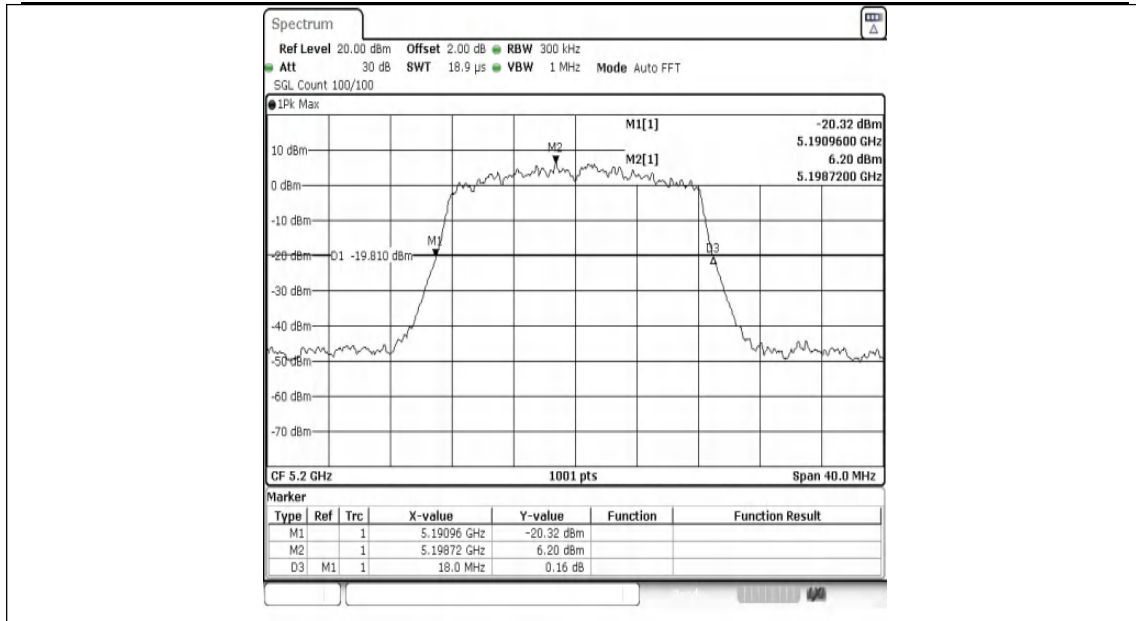


11A-Ant1-5200

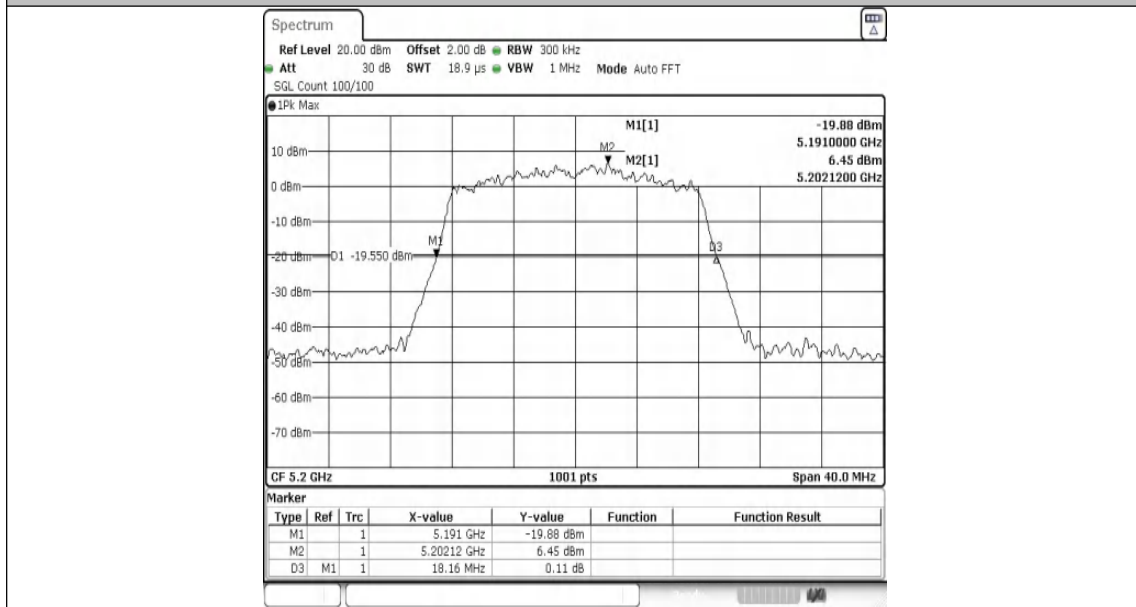


11A-Ant2-5200

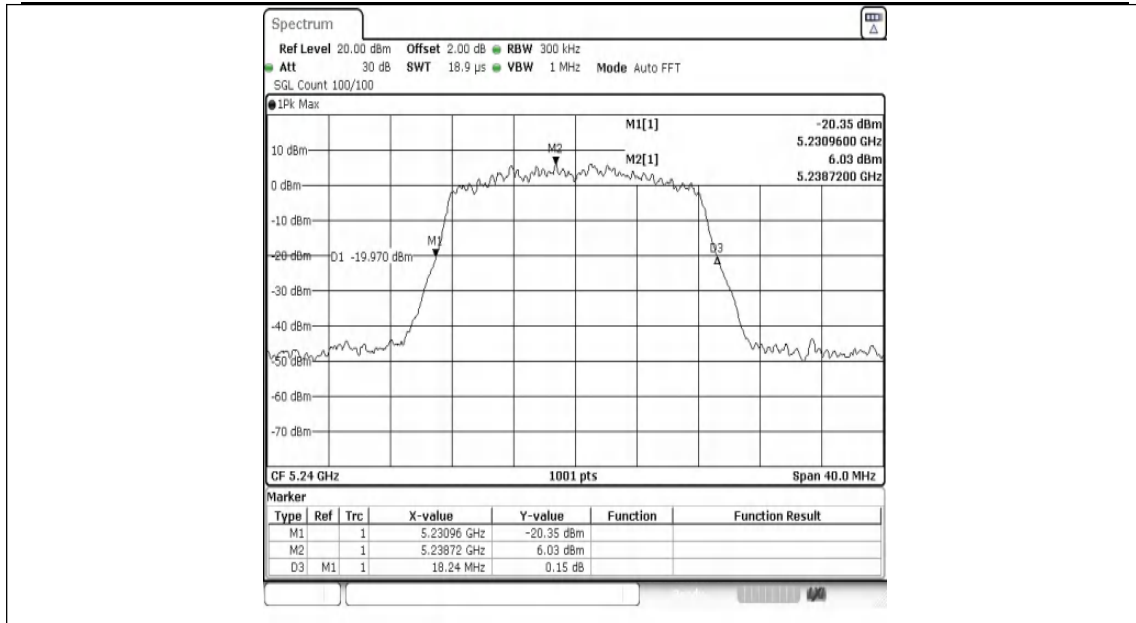


11A-Ant1-5240

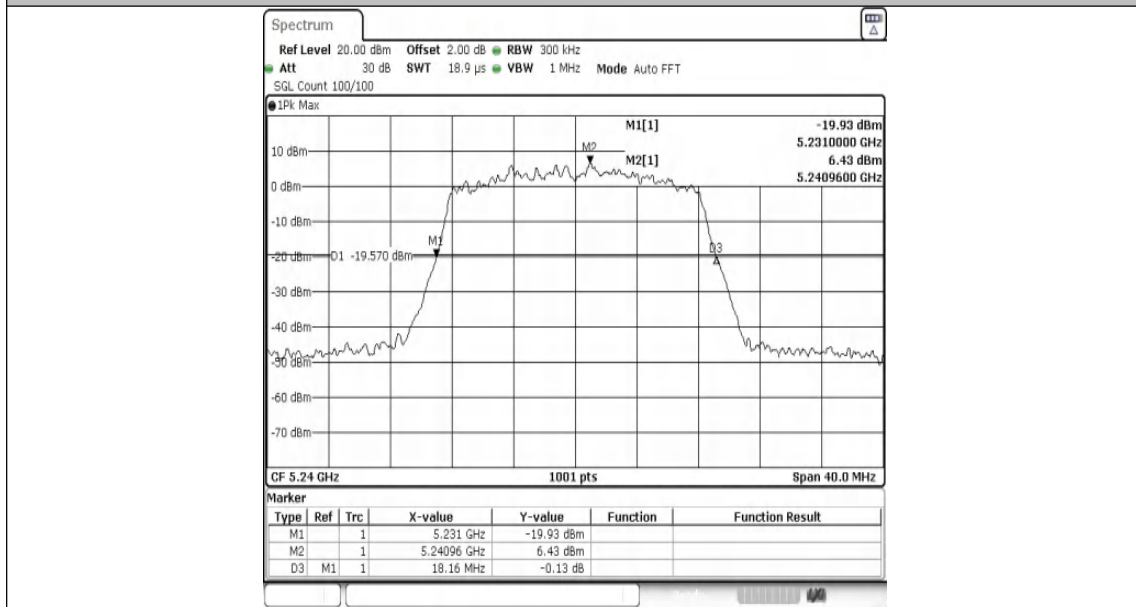


11A-Ant2-5240

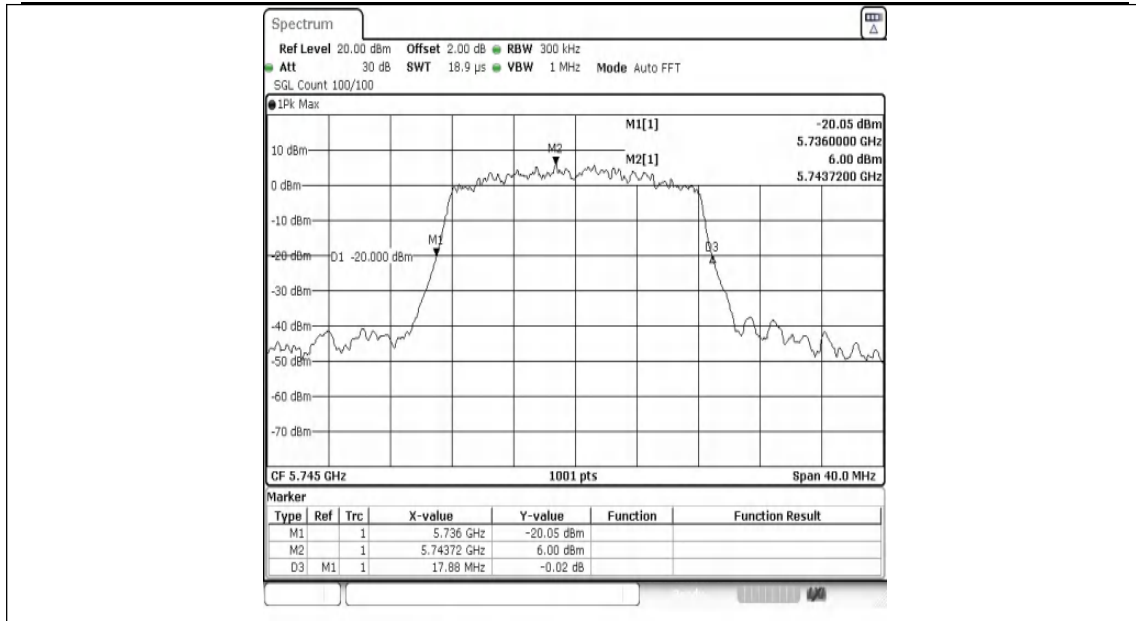



11A-Ant1-5745

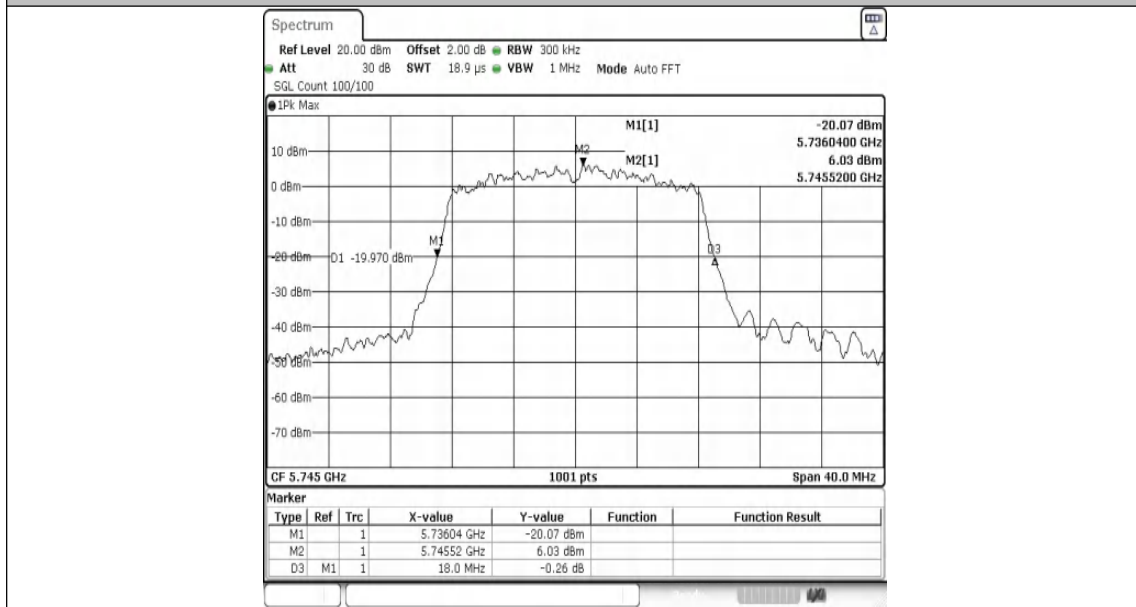


11A-Ant2-5745

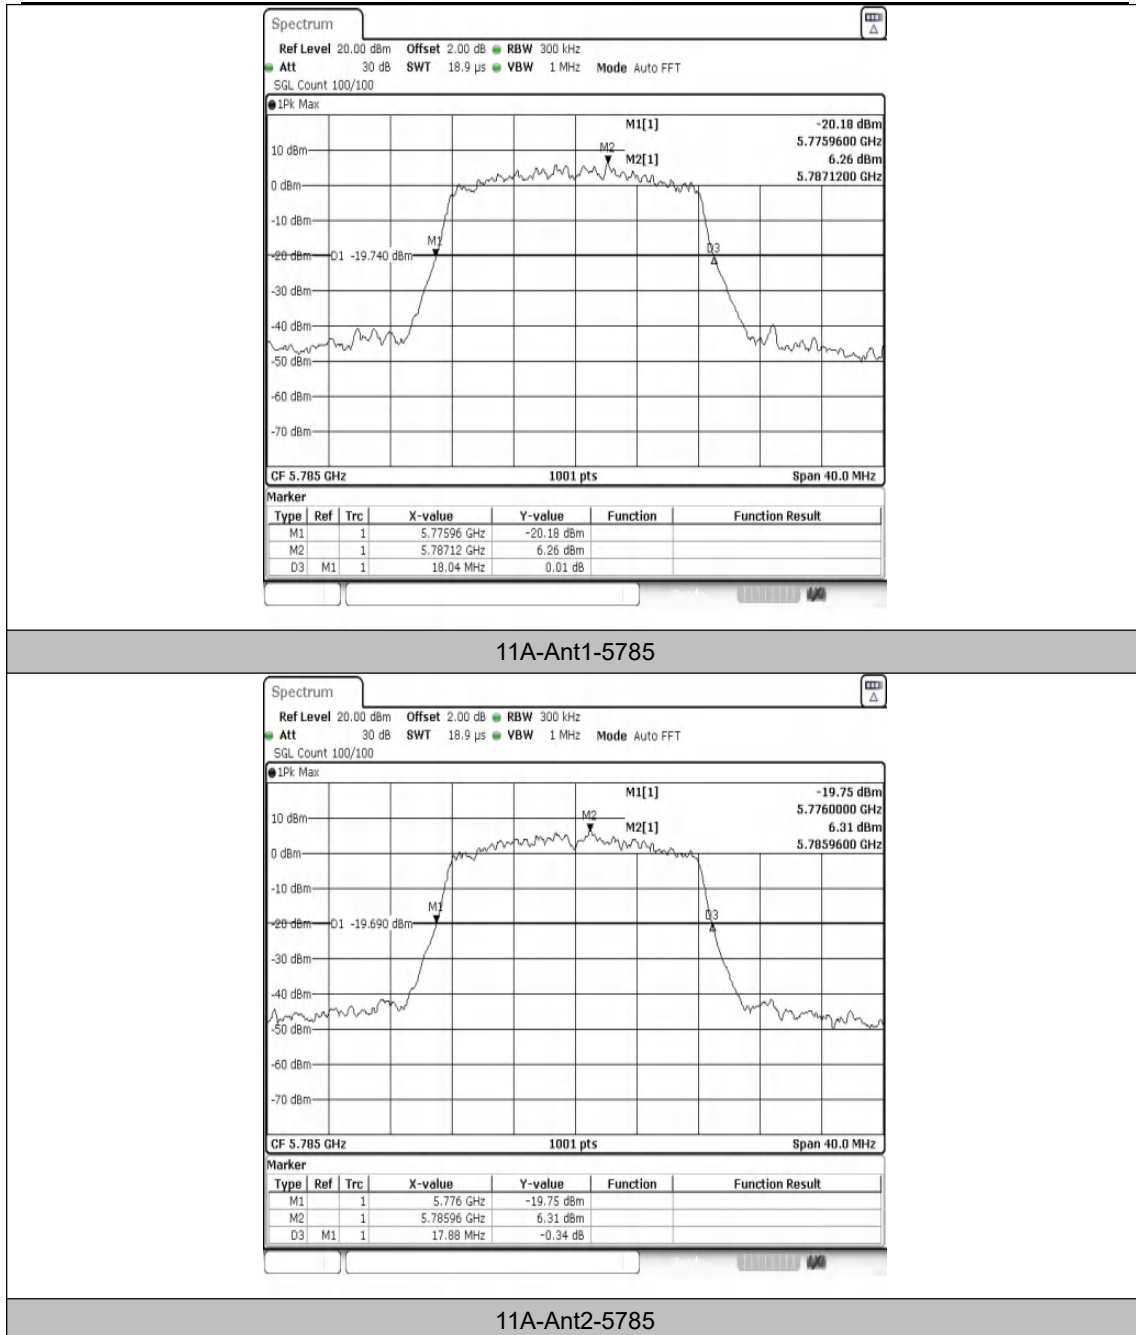

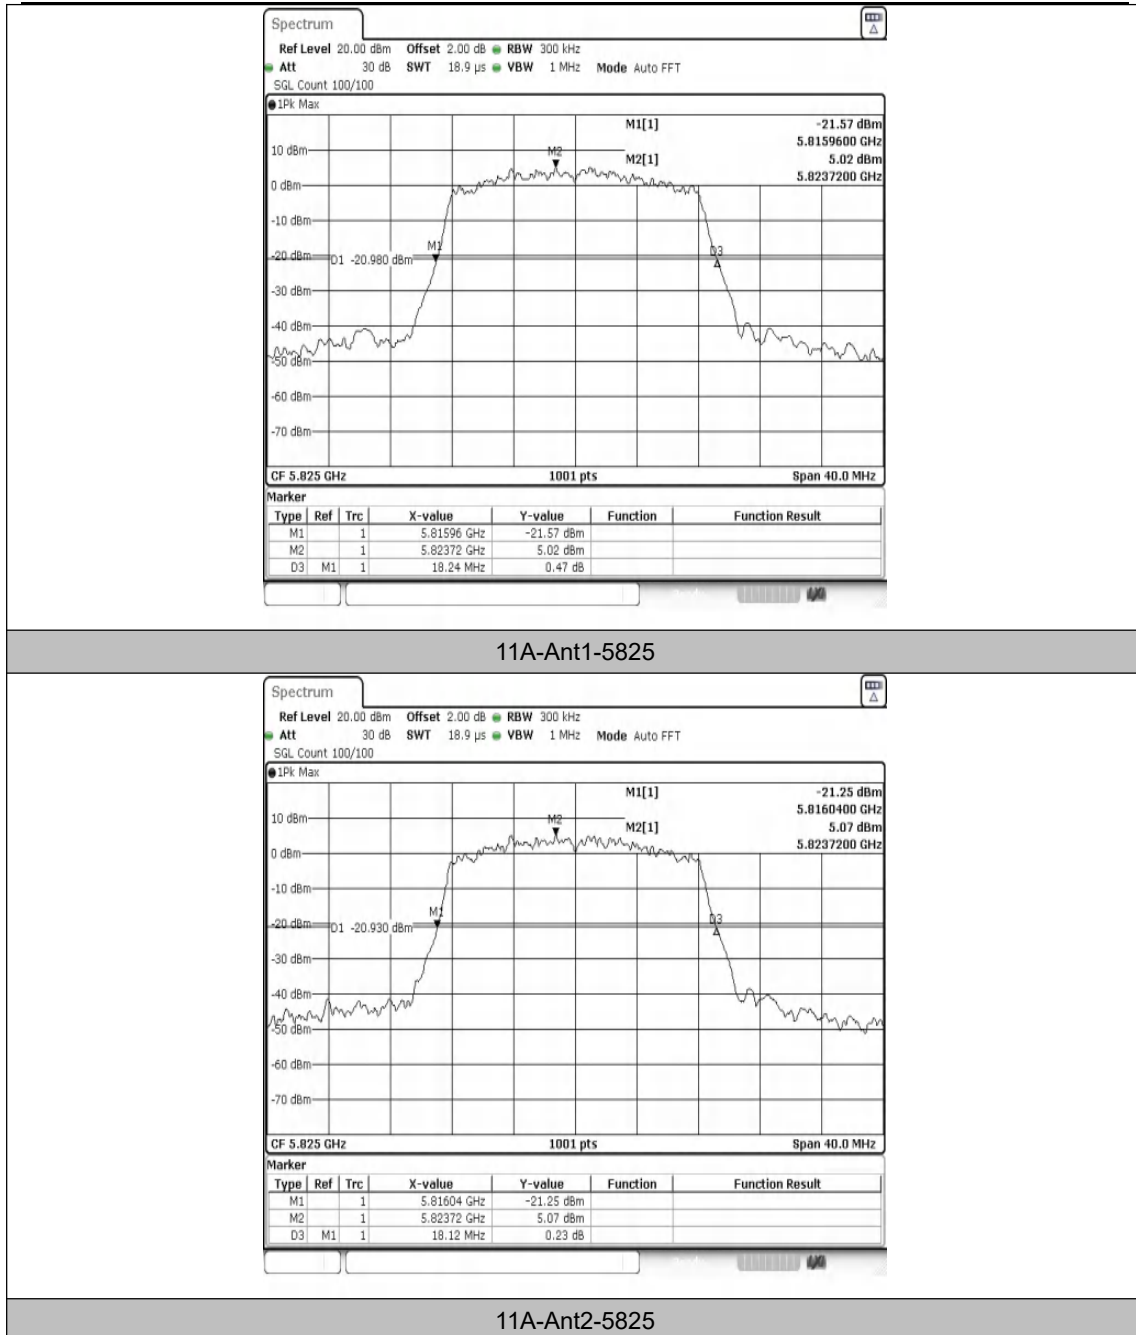


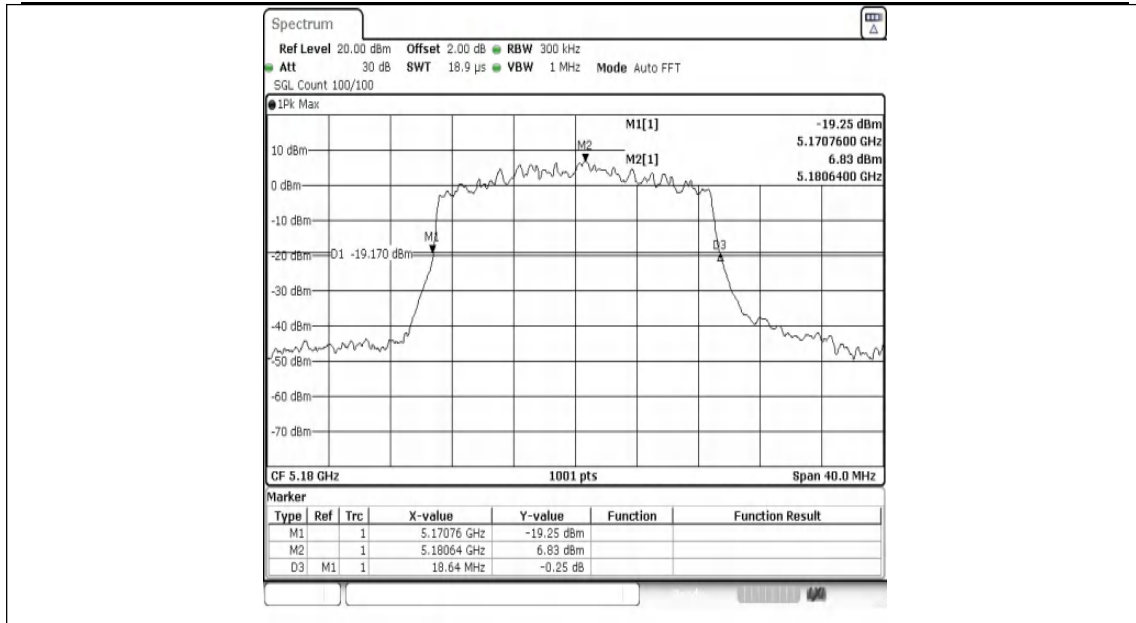


11N20MIMO-Ant1-5180

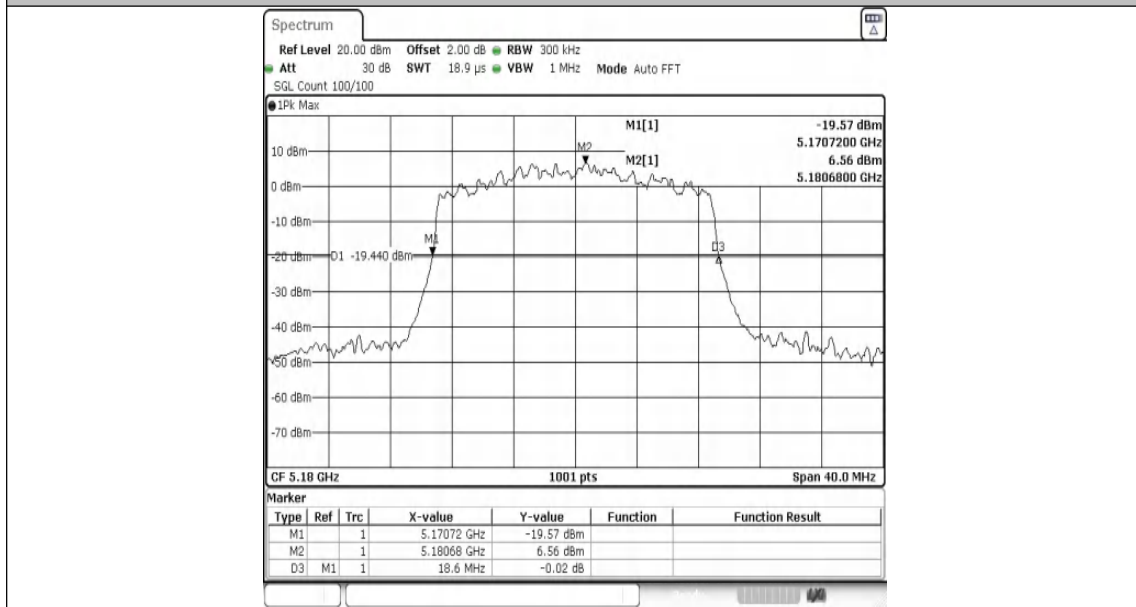


11N20MIMO-Ant2-5180

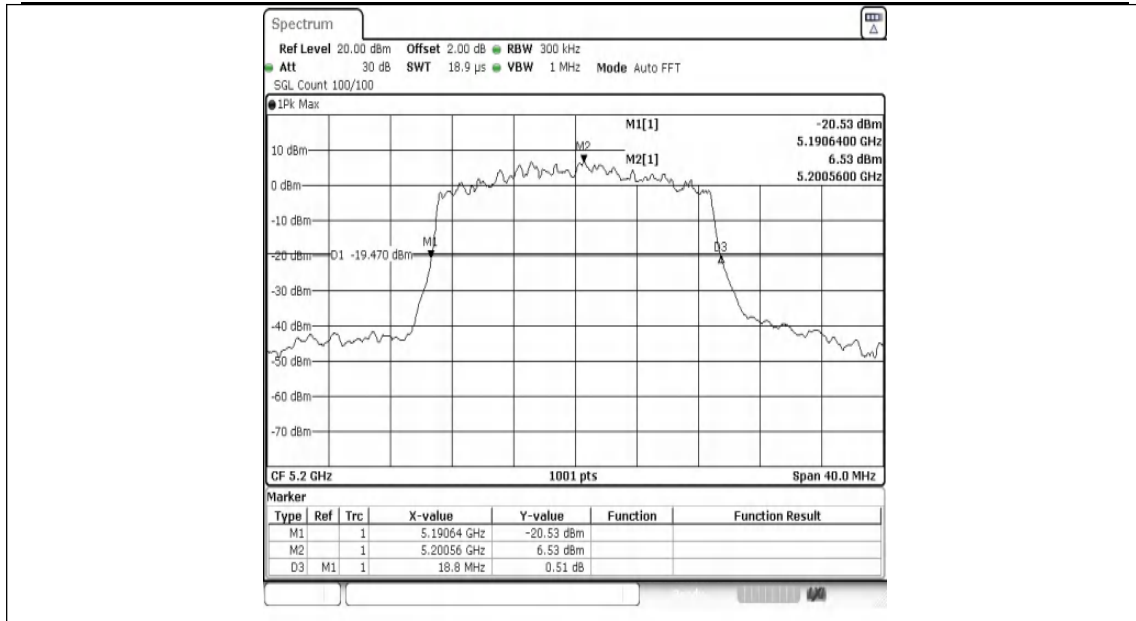

11N20MIMO-Ant1-5200

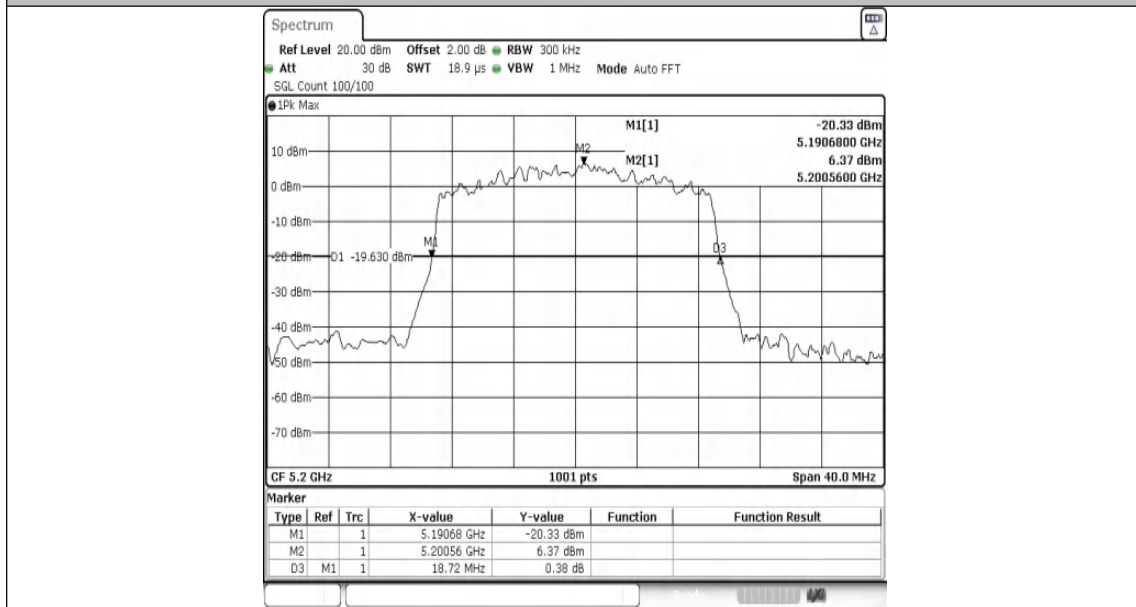


11N20MIMO-Ant2-5200

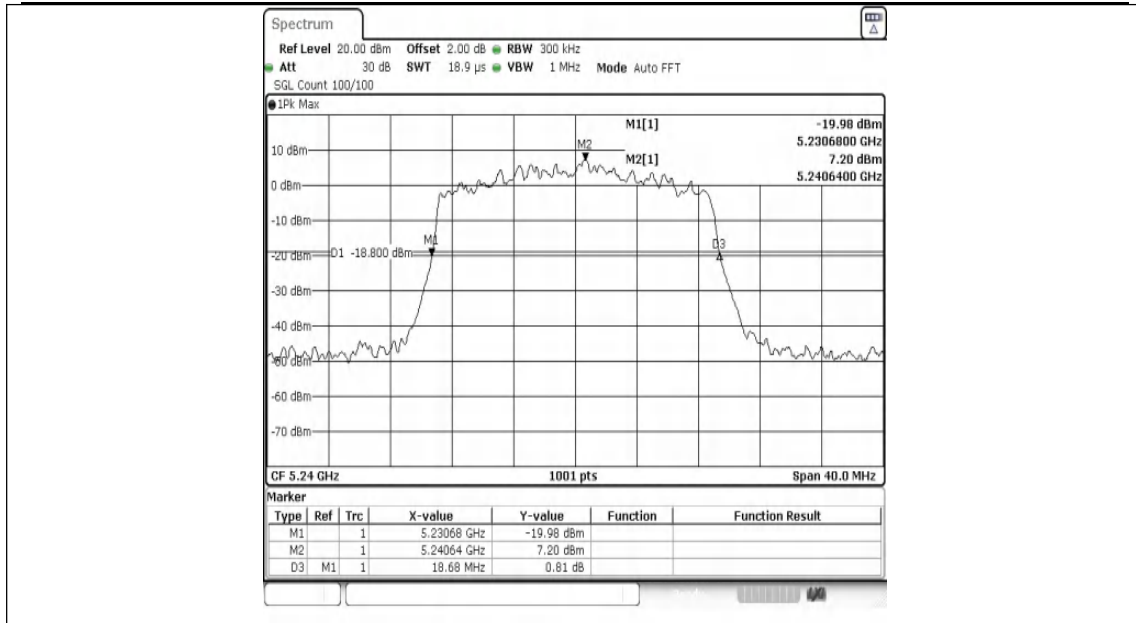


11N20MIMO-Ant1-5240




11N20MIMO-Ant2-5240

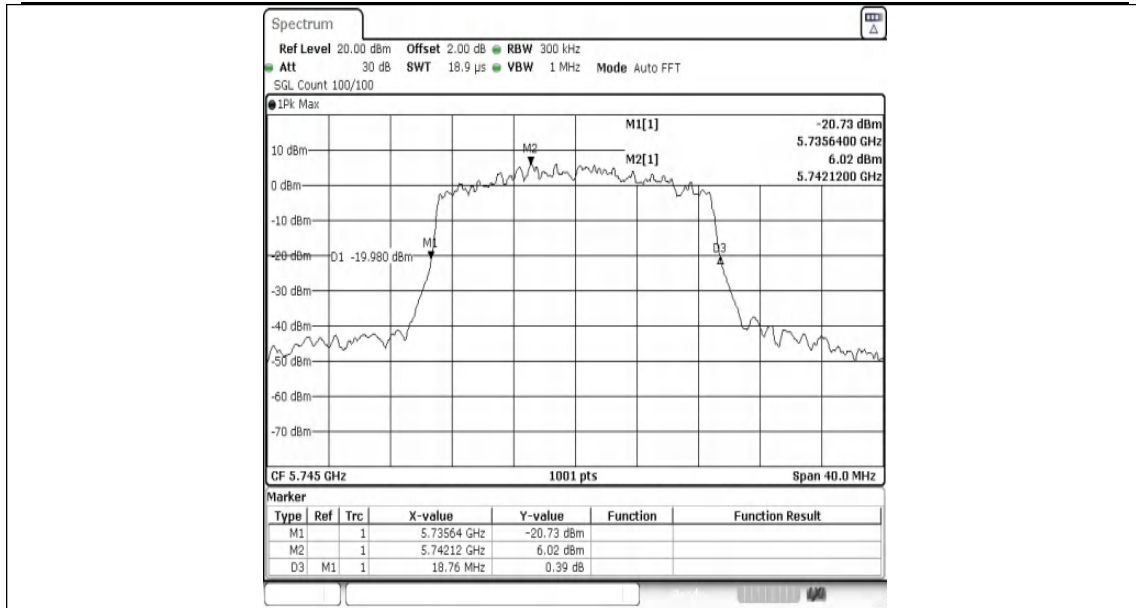


11N20MIMO-Ant1-5745

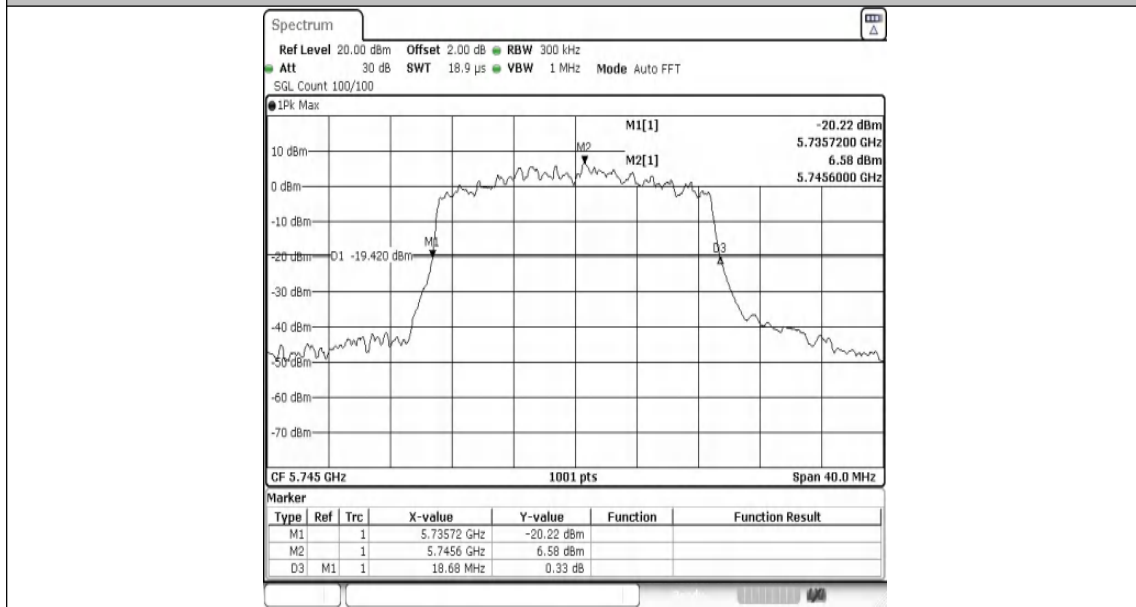


11N20MIMO-Ant2-5745

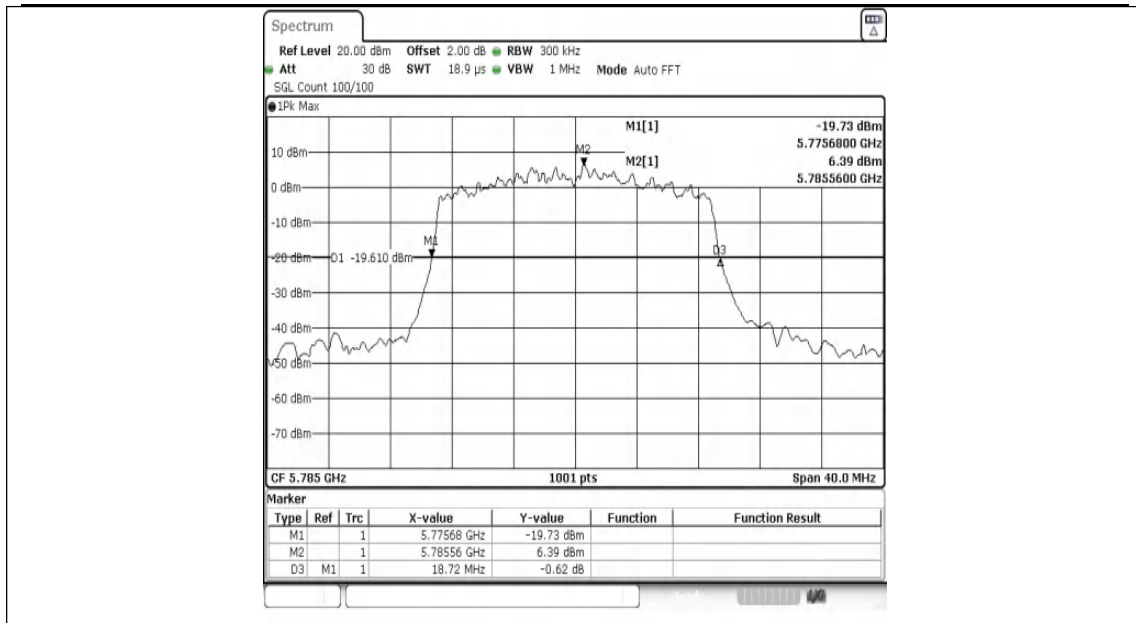


11N20MIMO-Ant1-5785

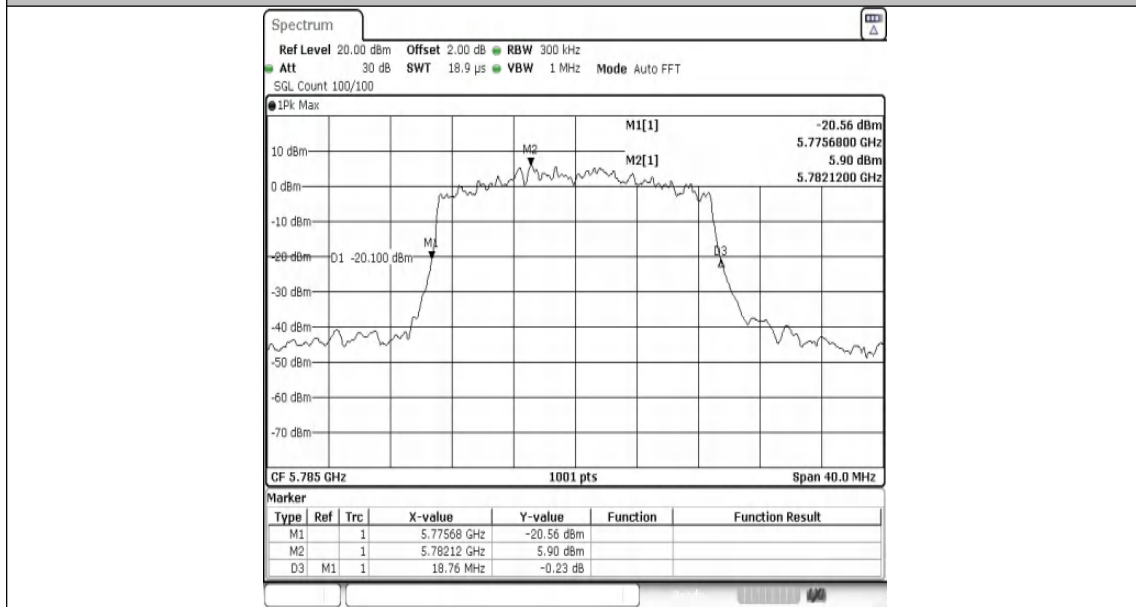


11N20MIMO-Ant2-5785

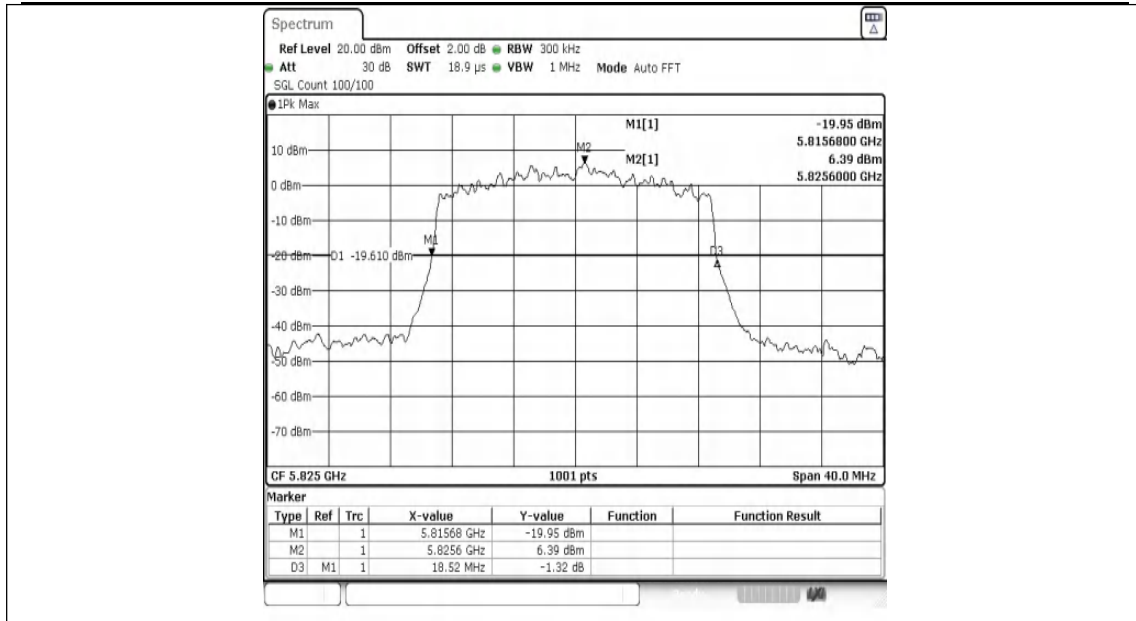


11N20MIMO-Ant1-5825

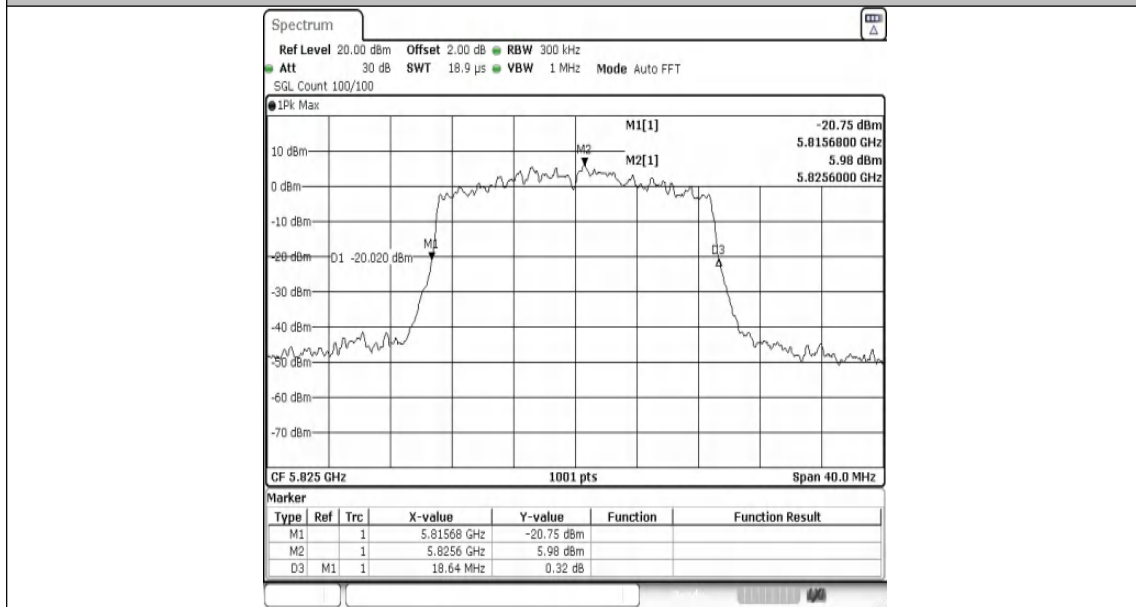


11N20MIMO-Ant2-5825

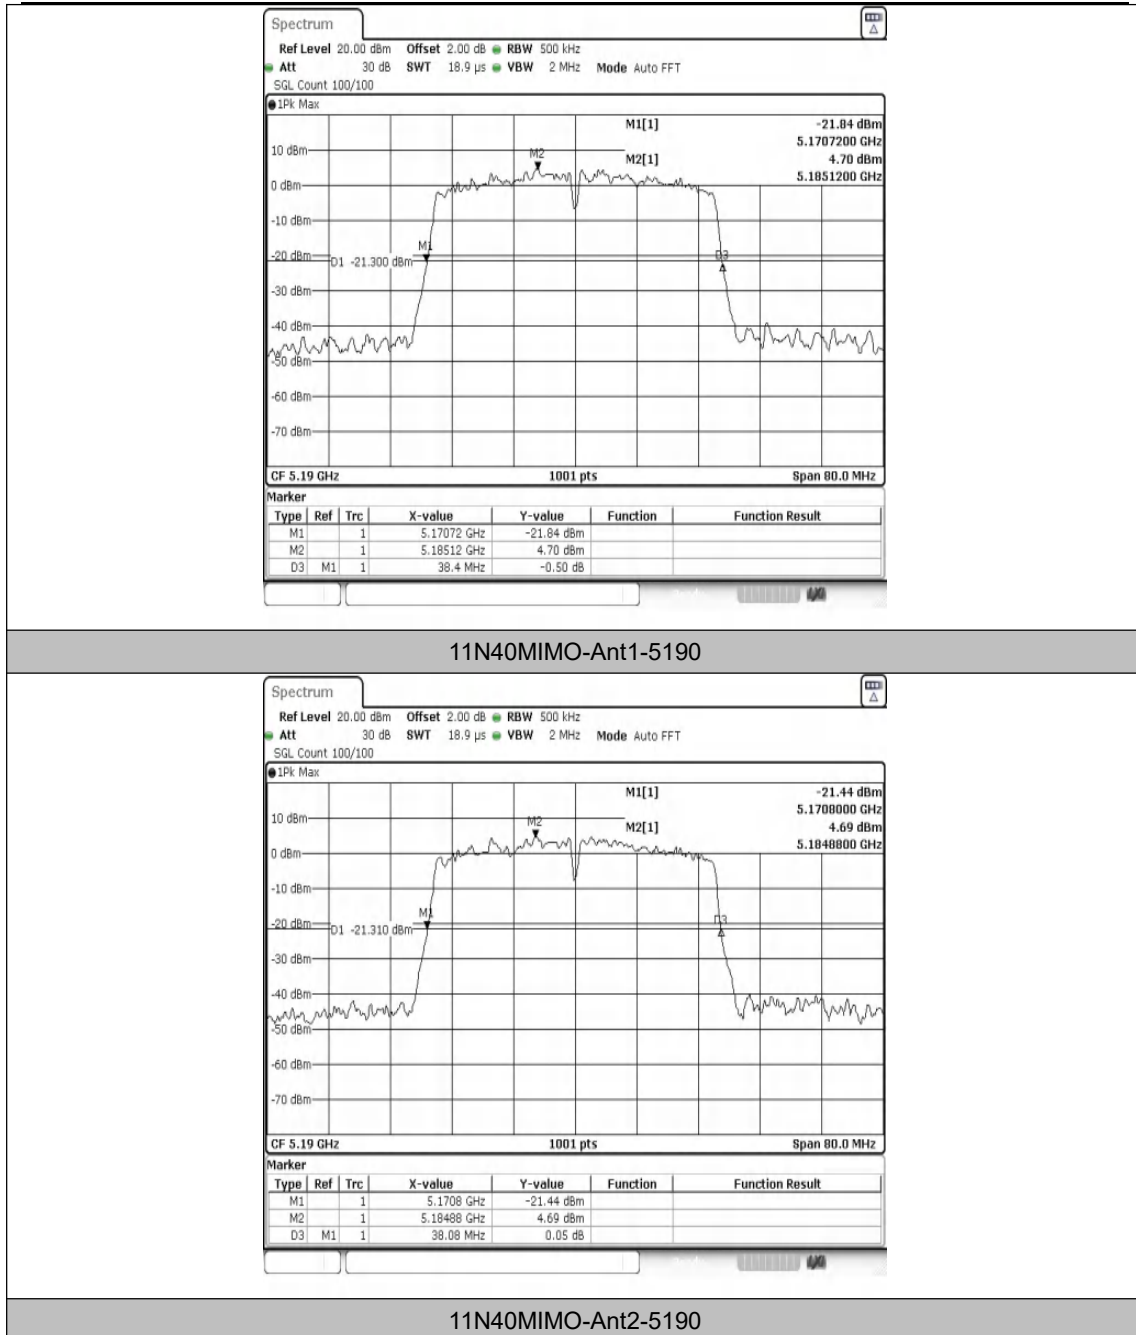


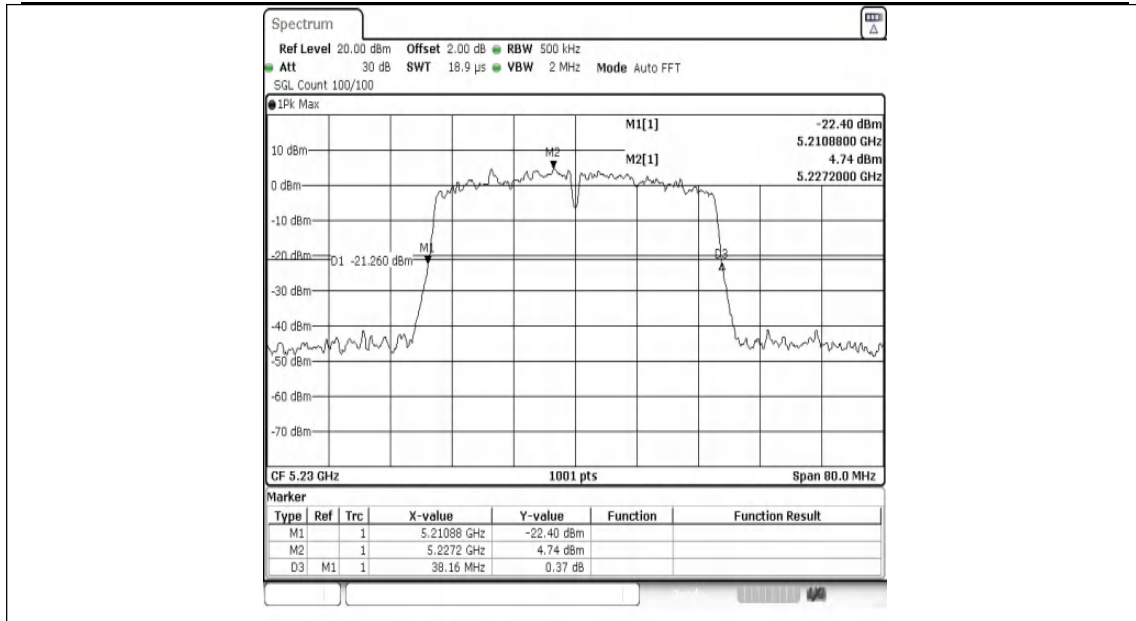


11N40MIMO-Ant1-5230

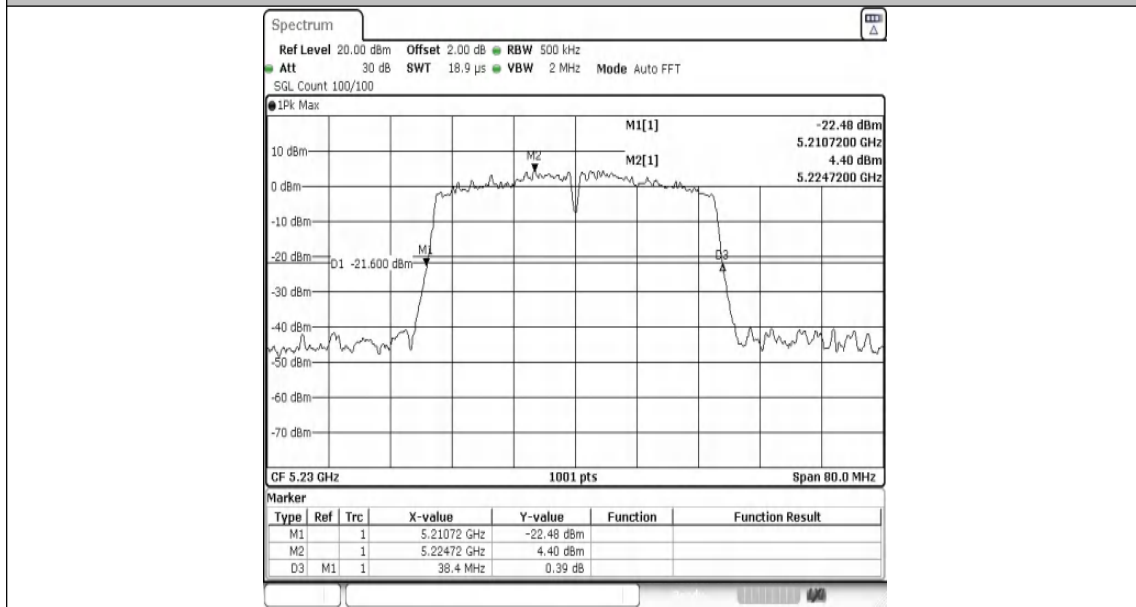


11N40MIMO-Ant2-5230

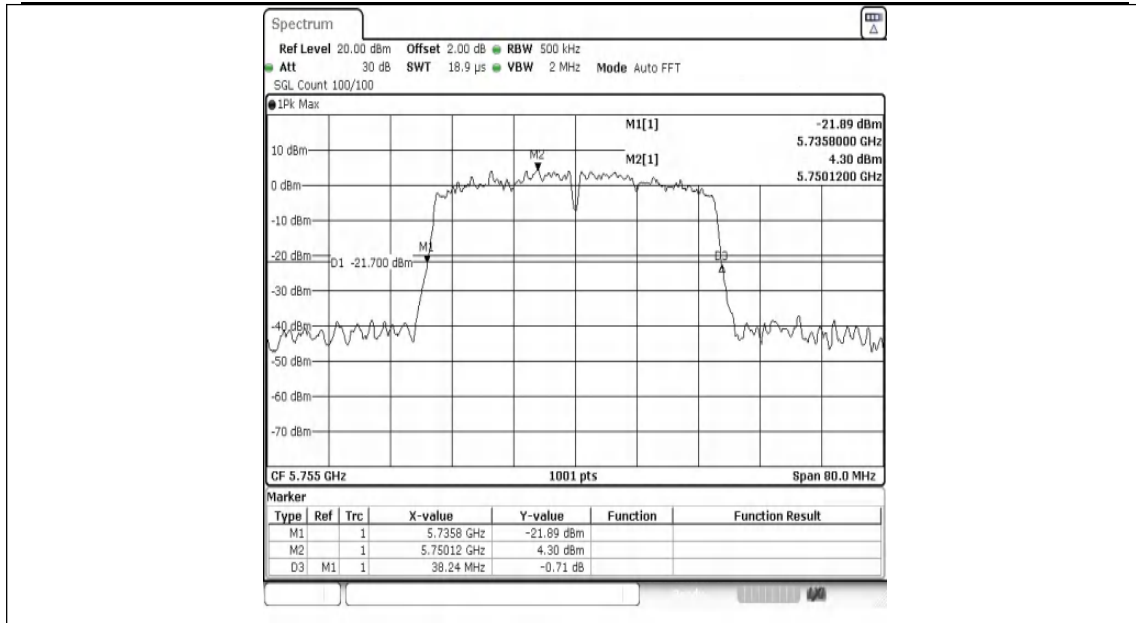


11N40MIMO-Ant1-5755

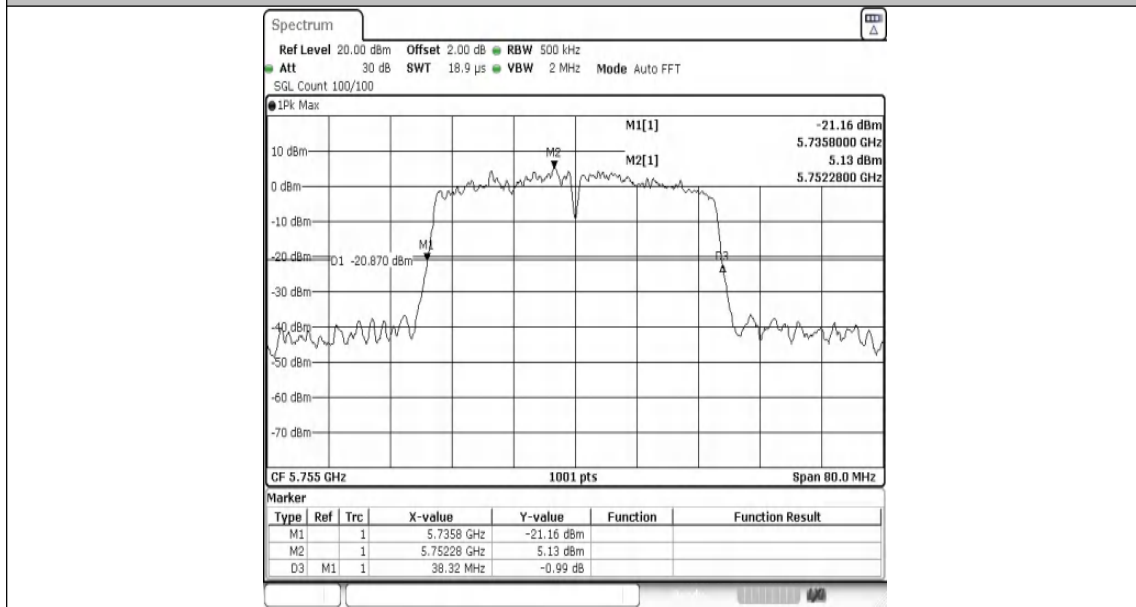


11N40MIMO-Ant2-5755

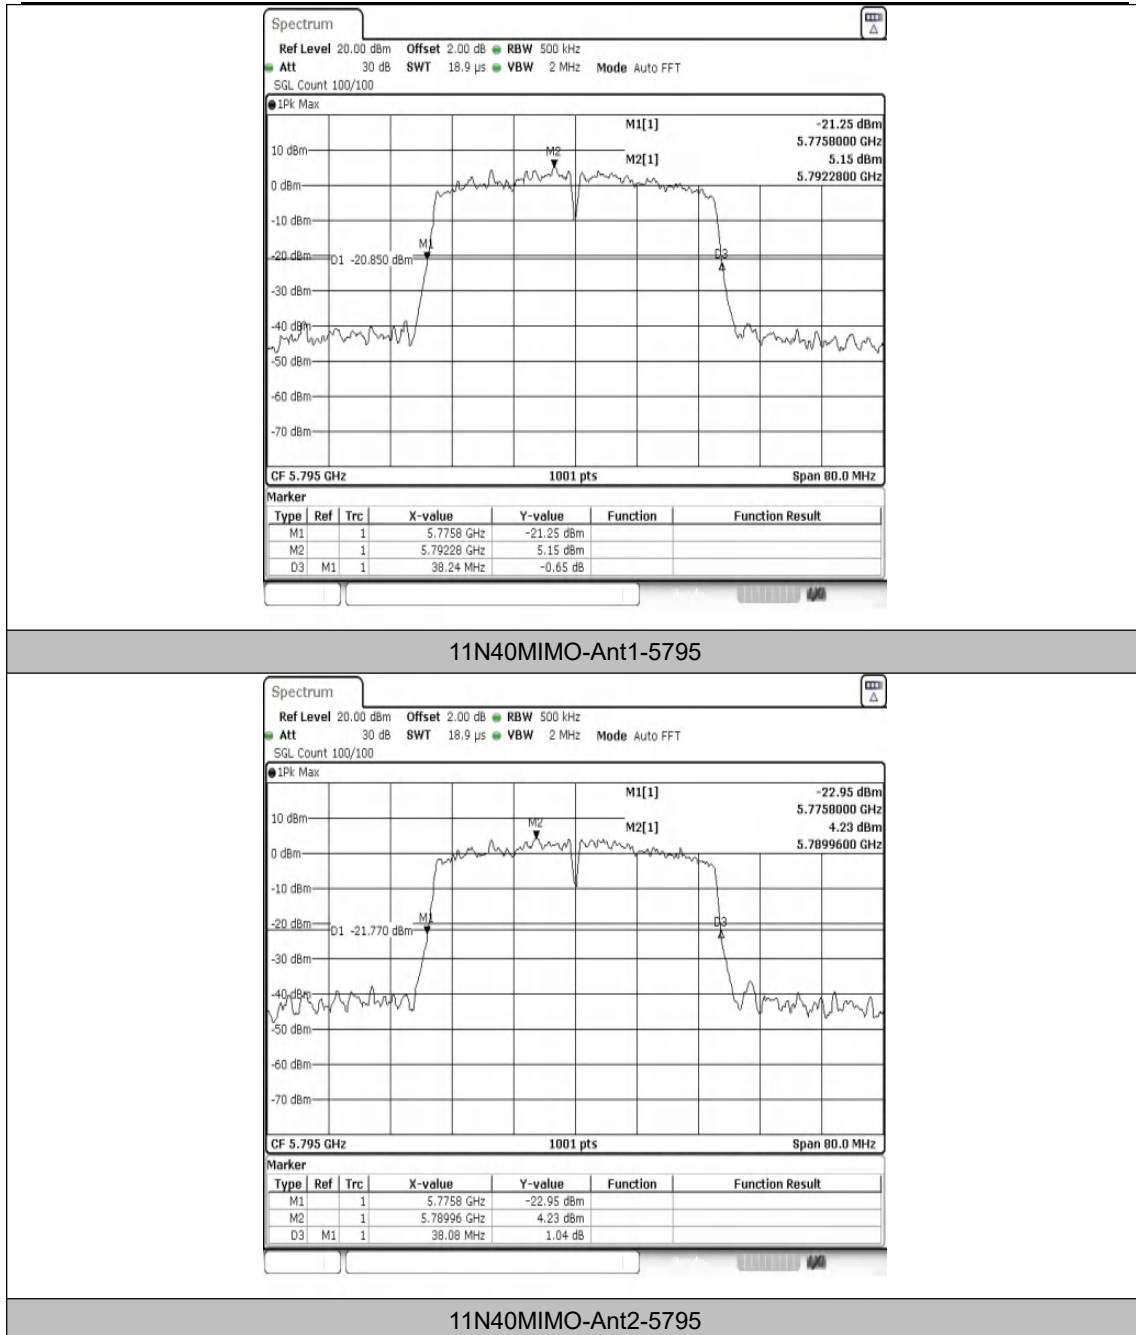


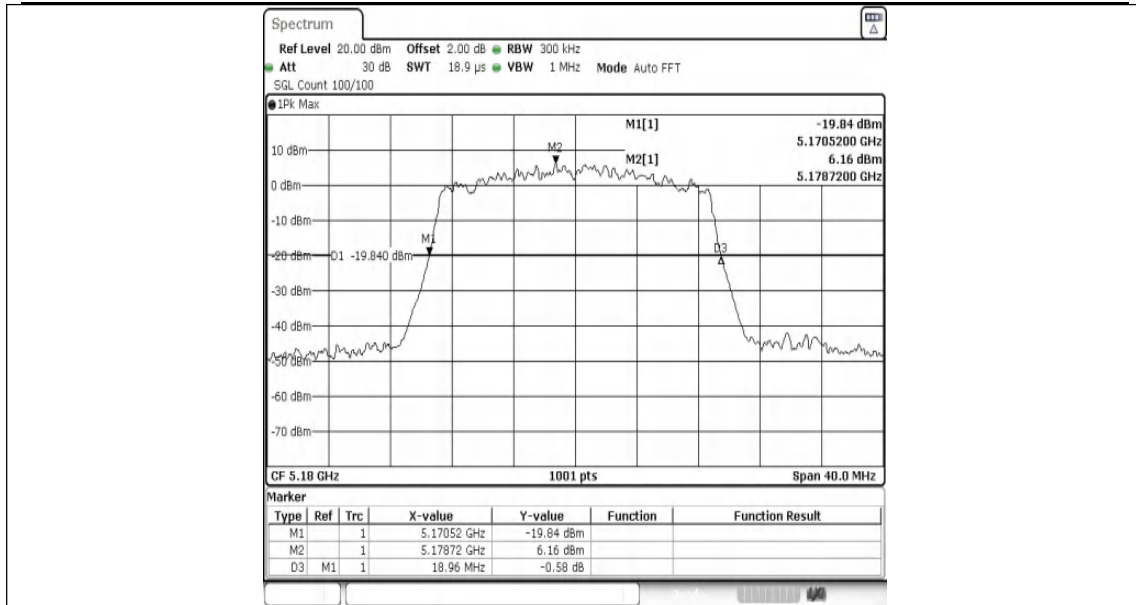


11AC20MIMO-Ant1-5180

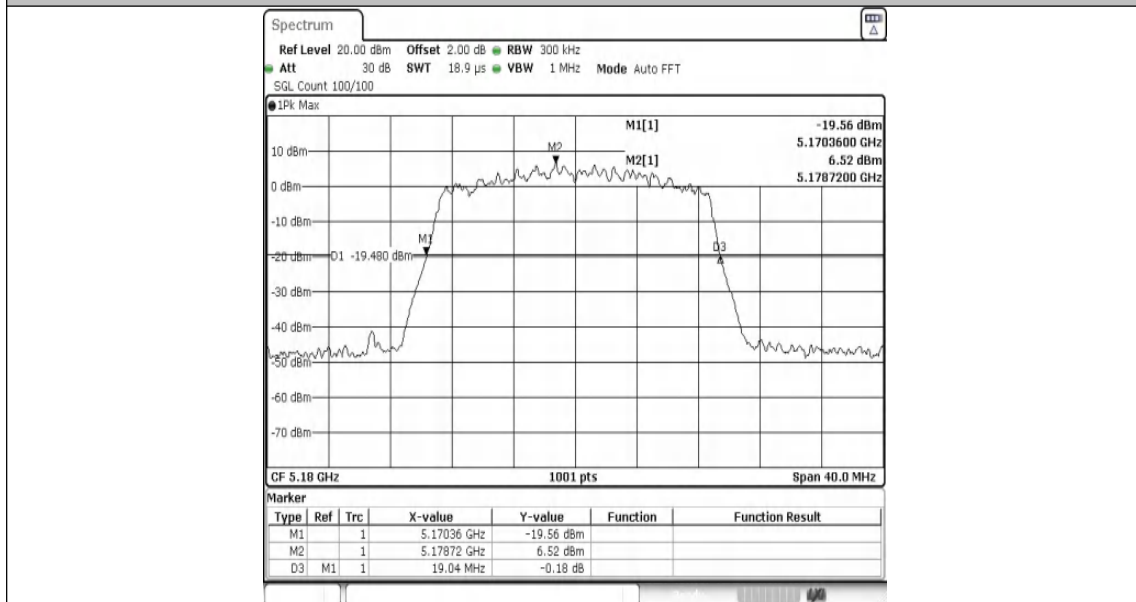


11AC20MIMO-Ant2-5180

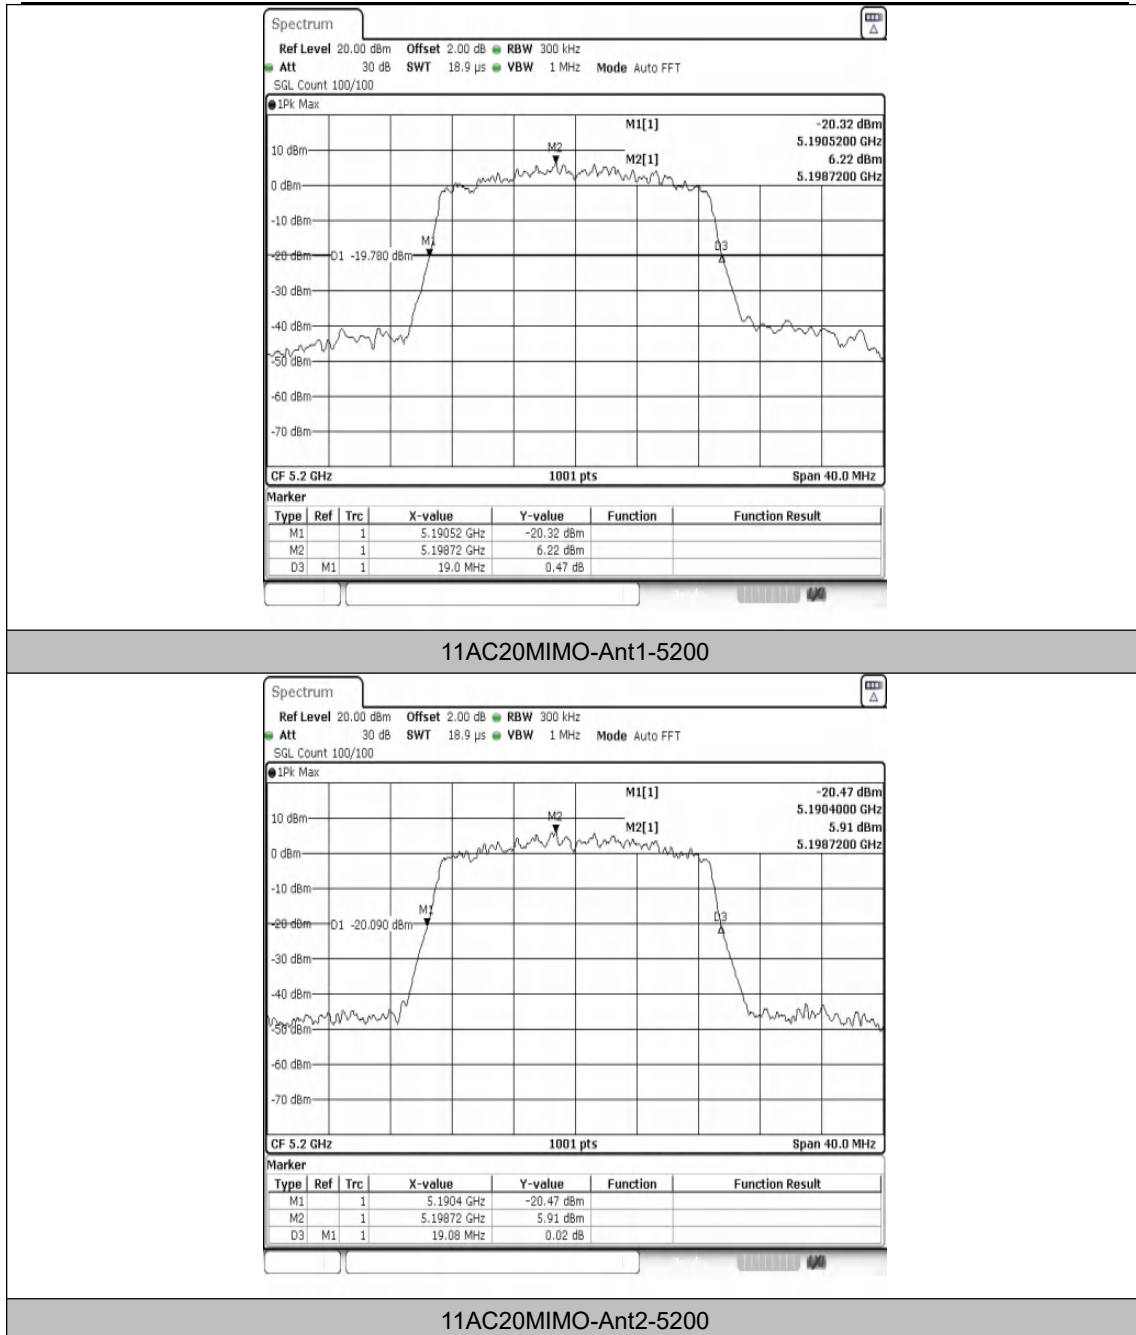


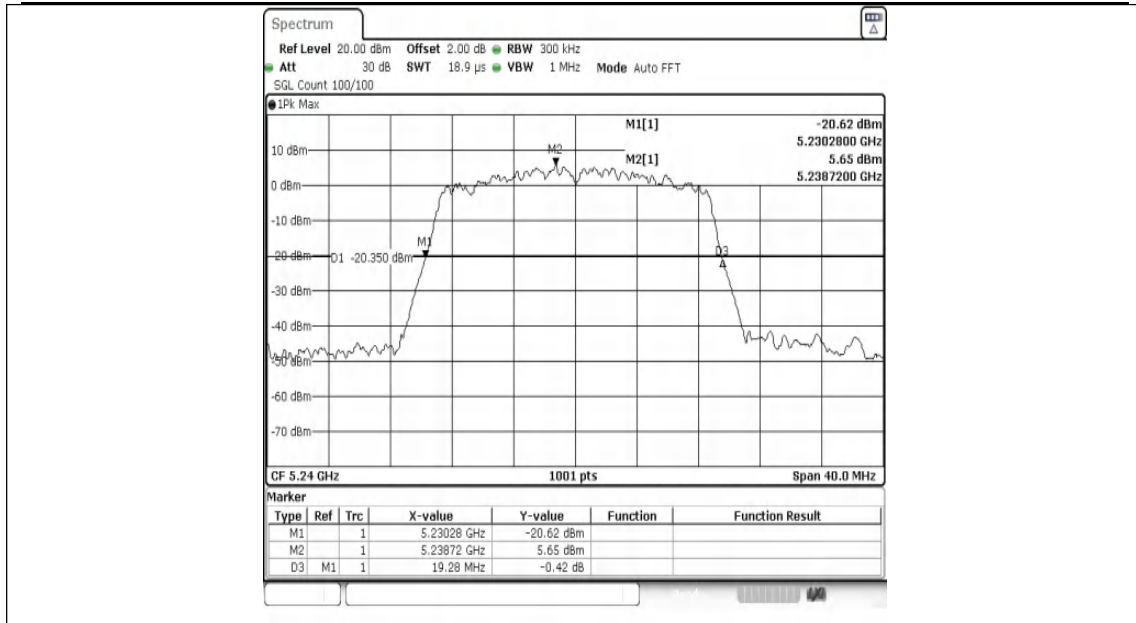


11AC20MIMO-Ant1-5240

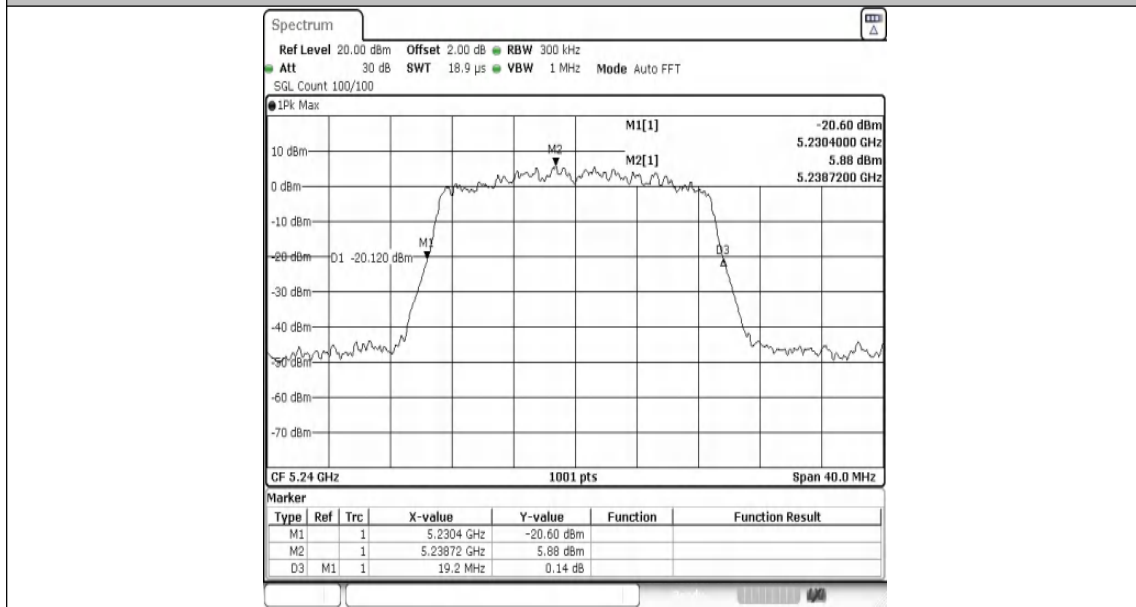


11AC20MIMO-Ant2-5240

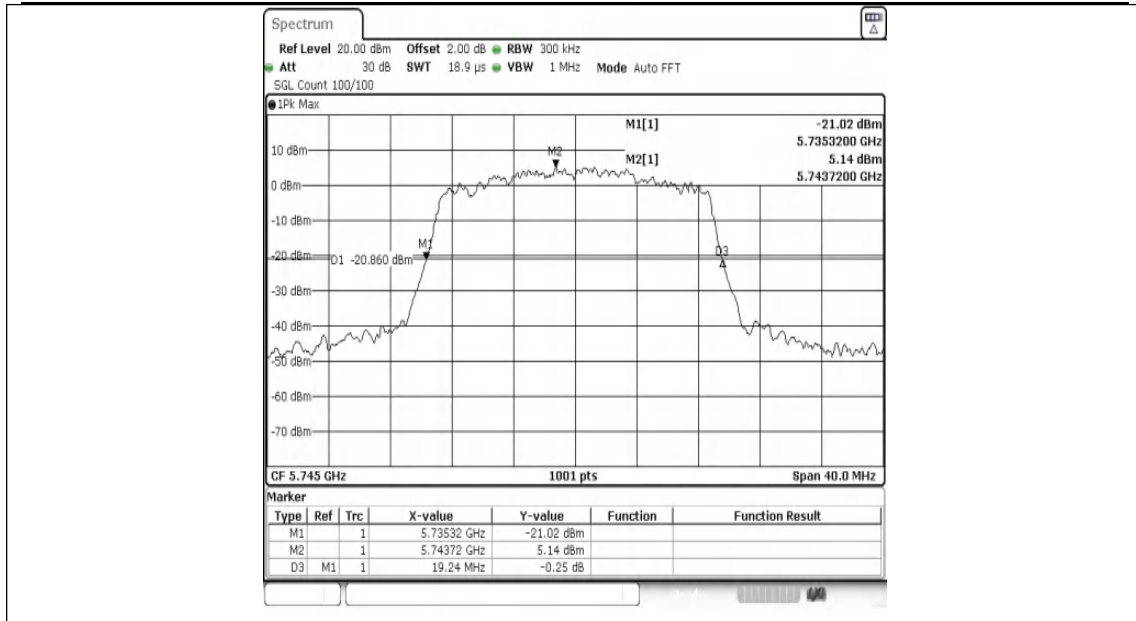



11AC20MIMO-Ant1-5745

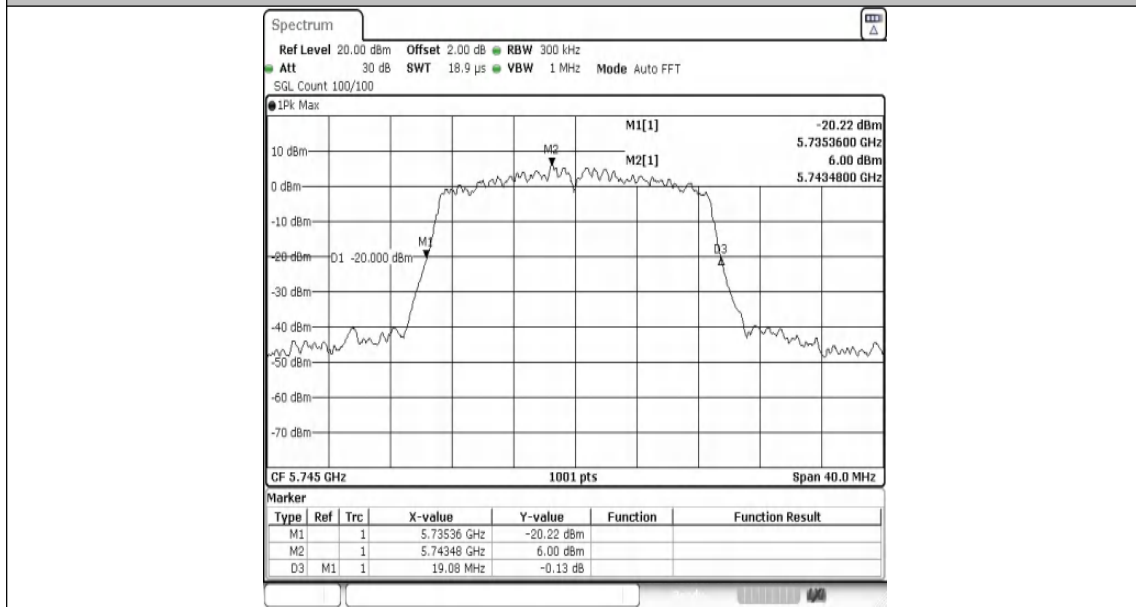


11AC20MIMO-Ant2-5745

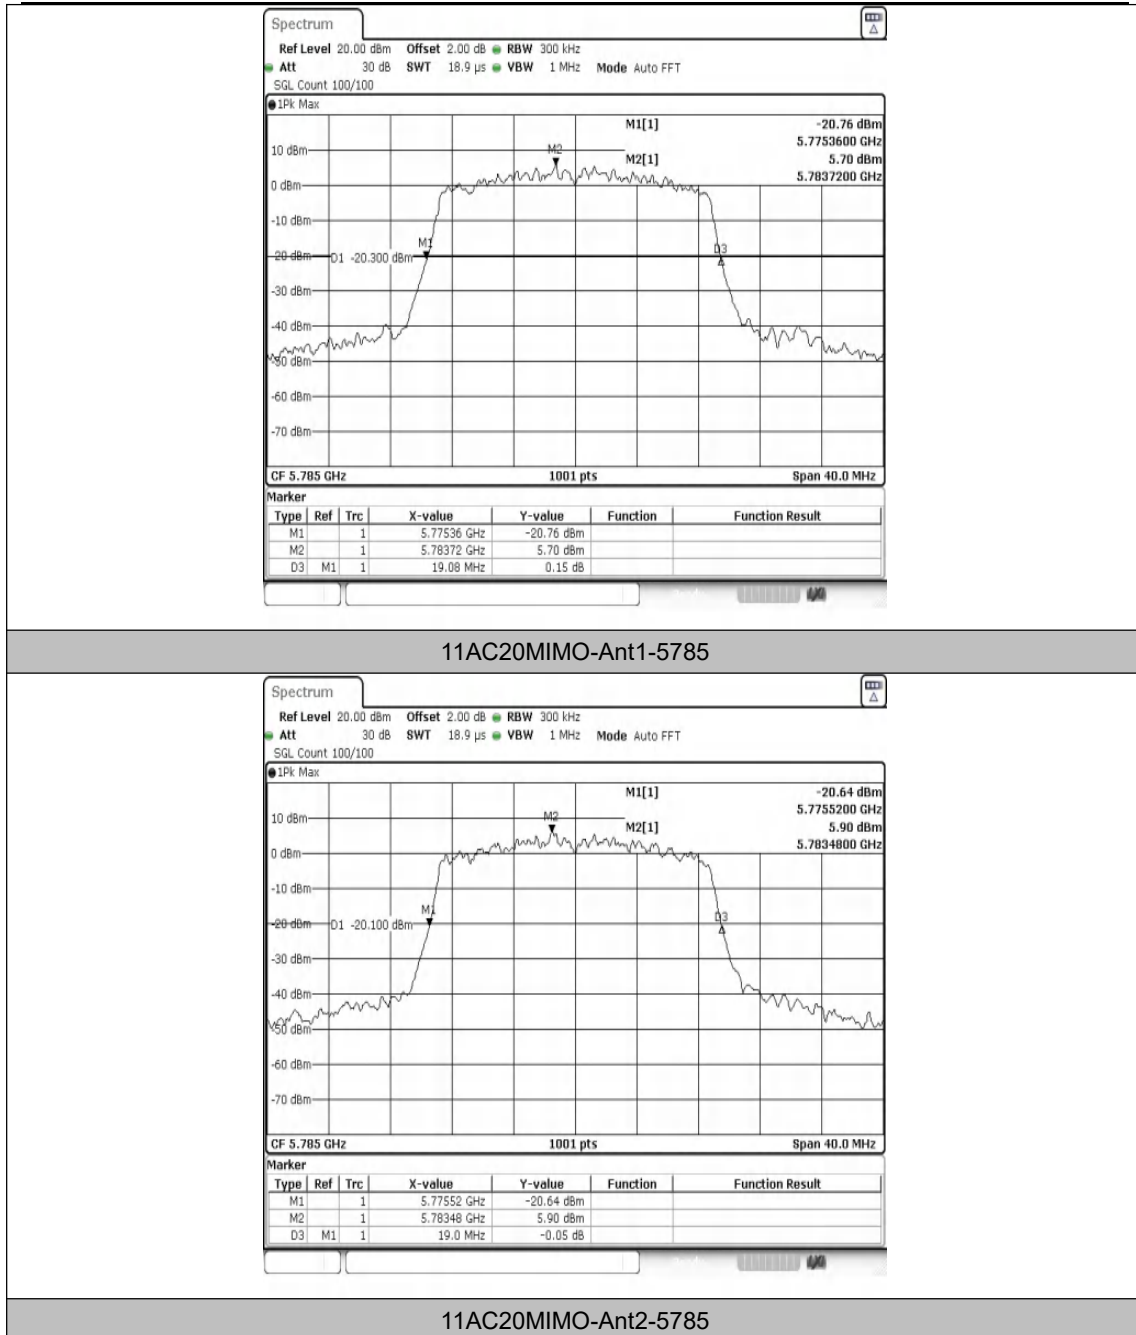

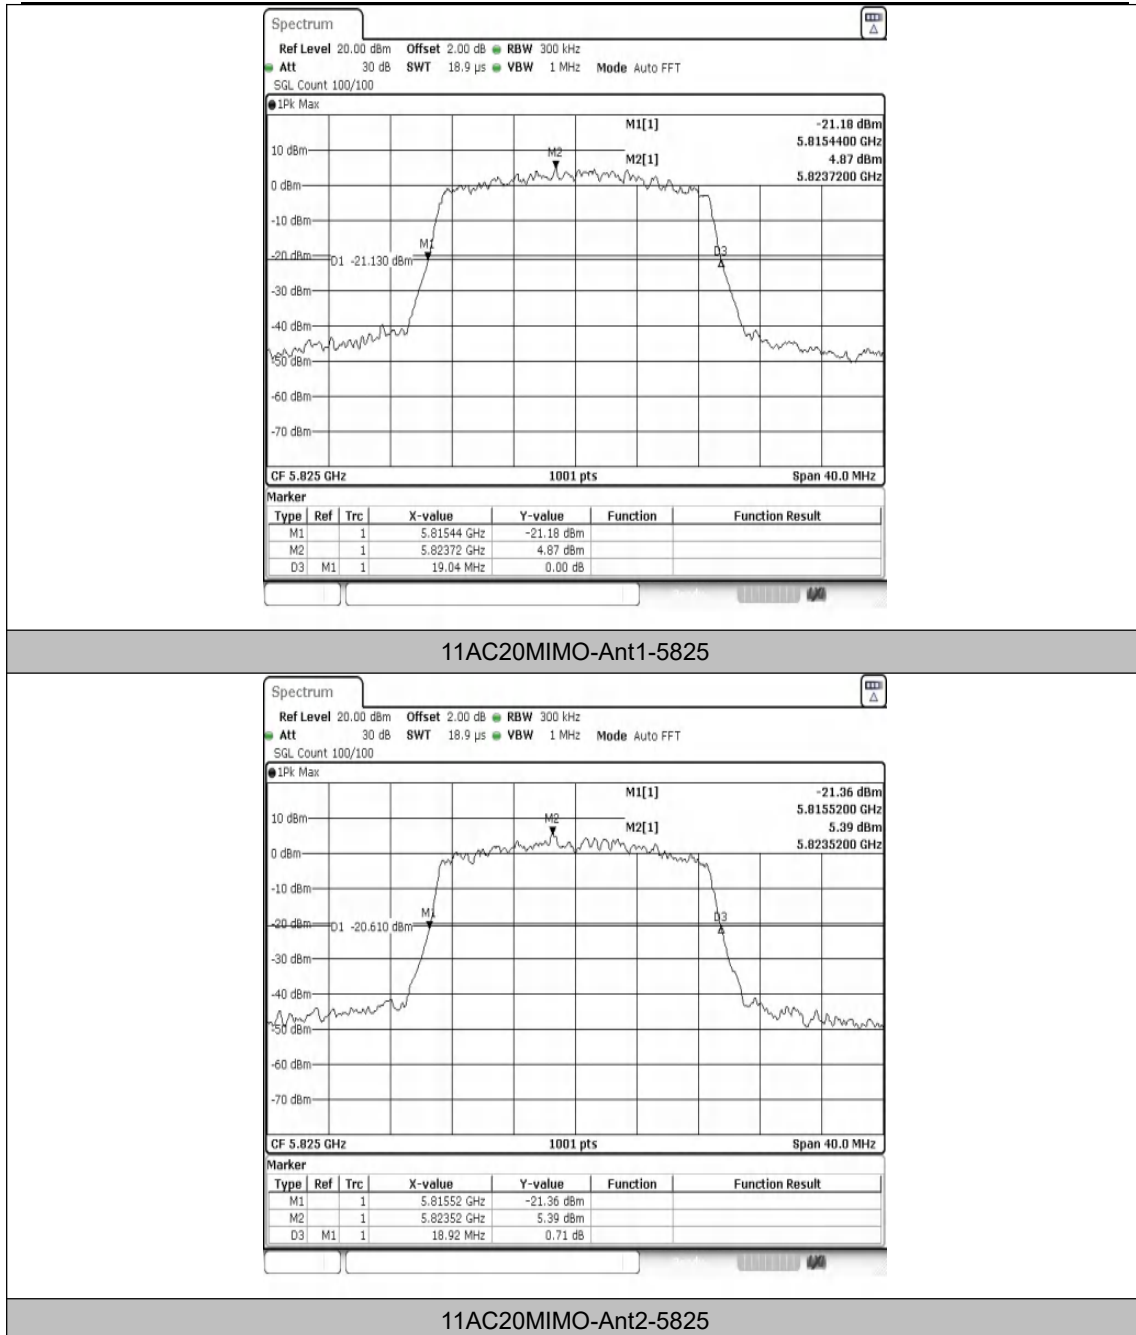


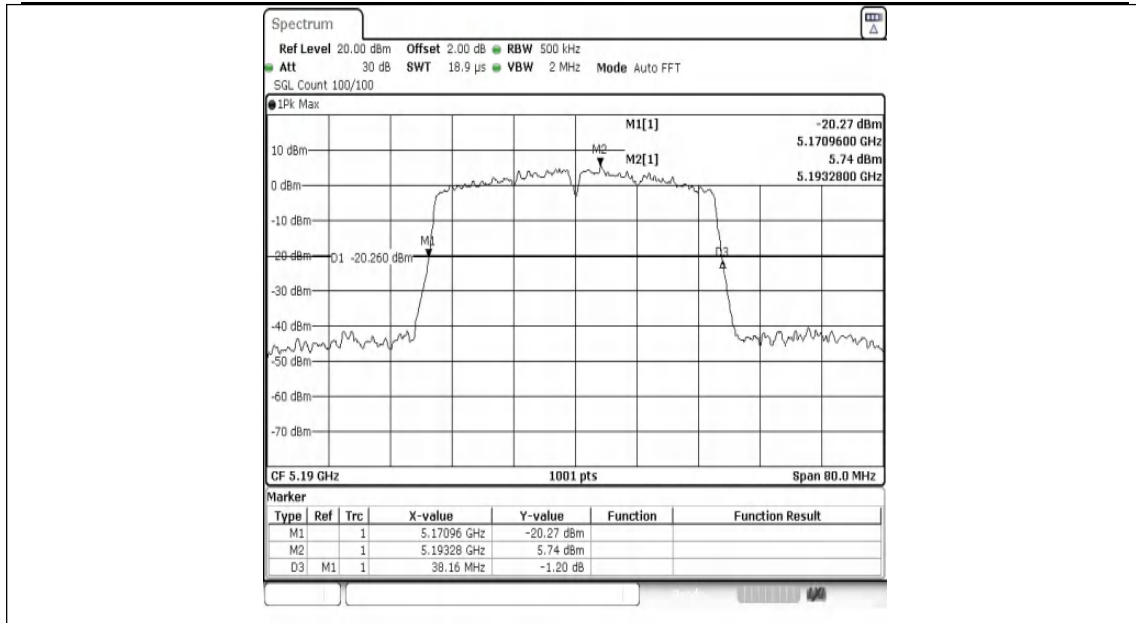


11AC40MIMO-Ant1-5190

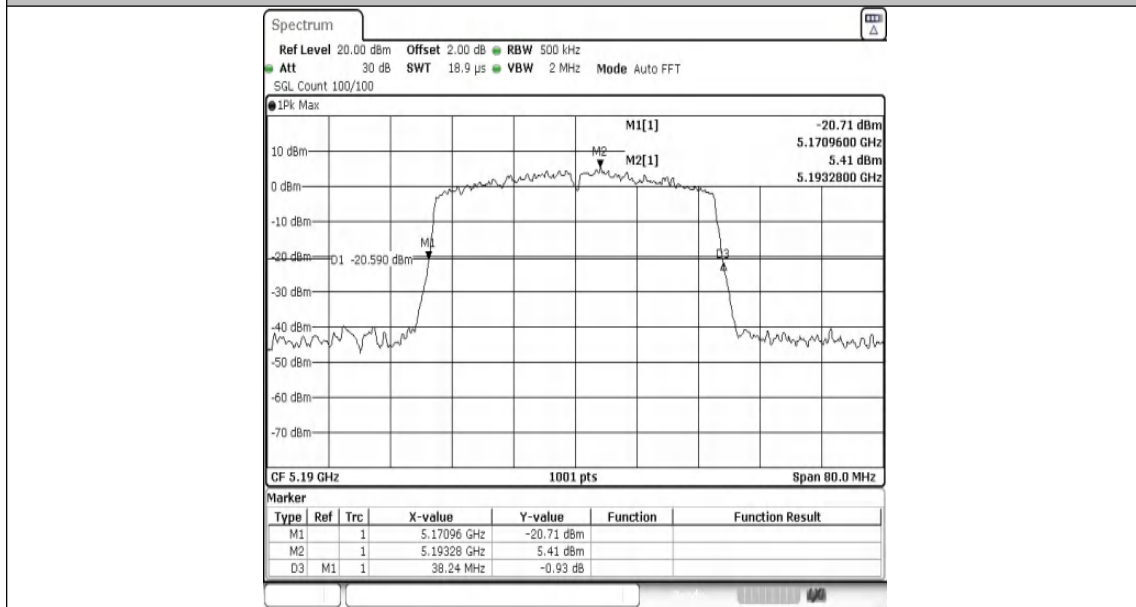


11AC40MIMO-Ant2-5190

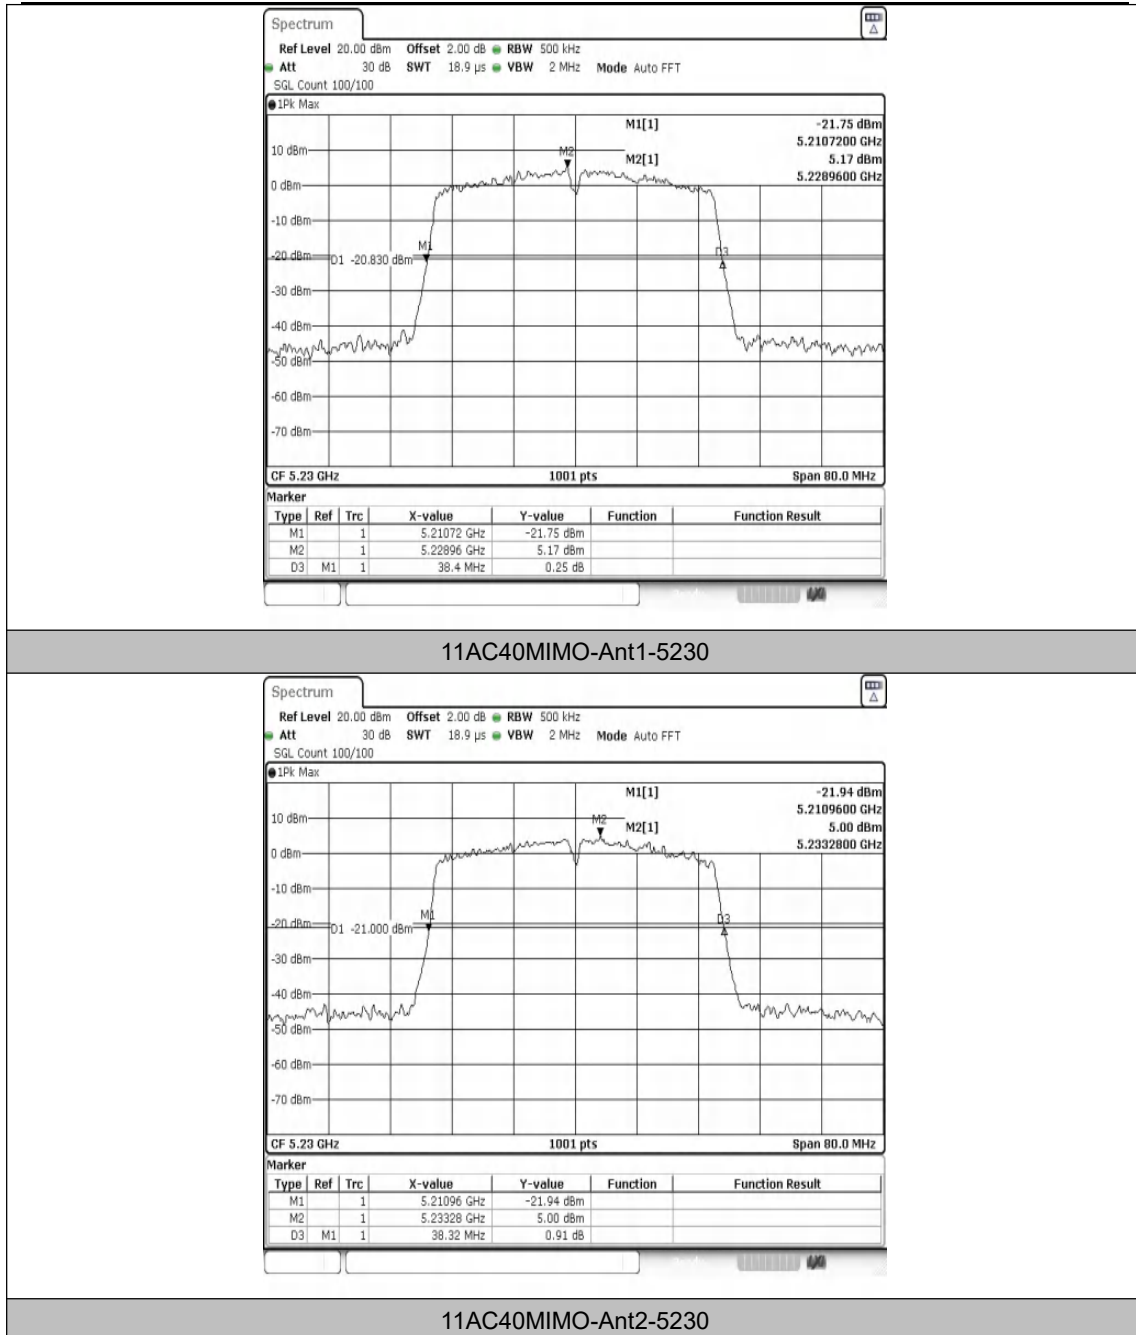


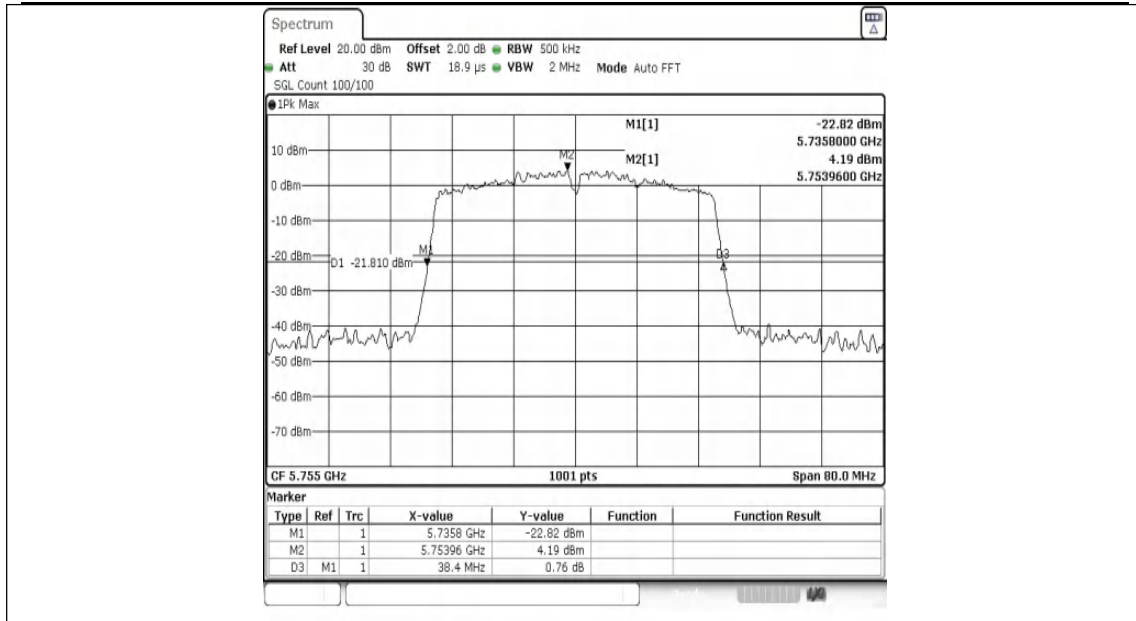



11AC40MIMO-Ant1-5755

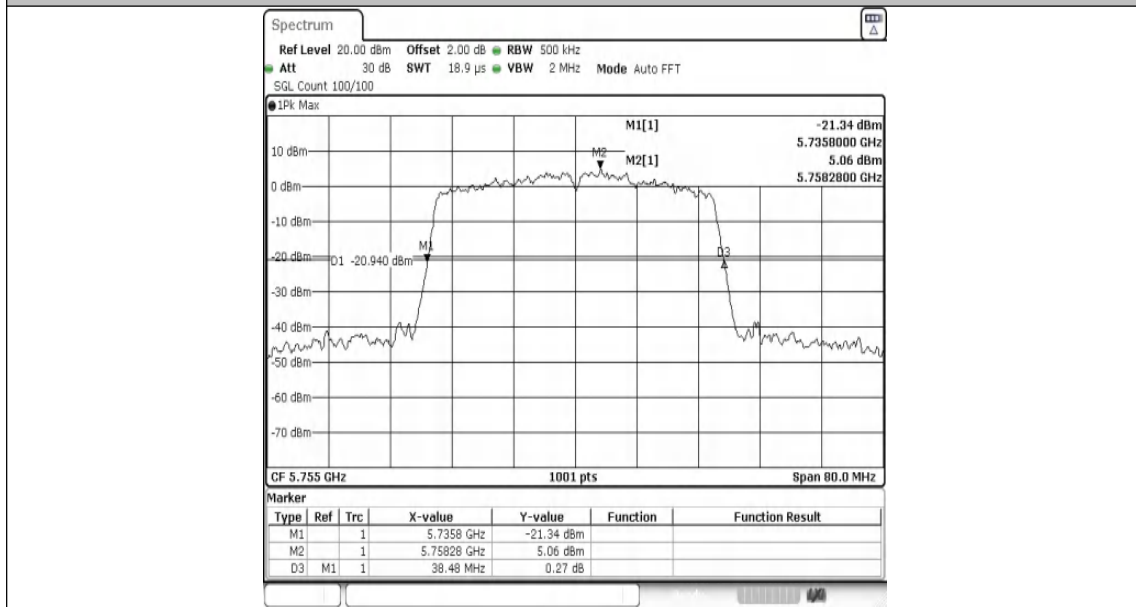

11AC40MIMO-Ant2-5755

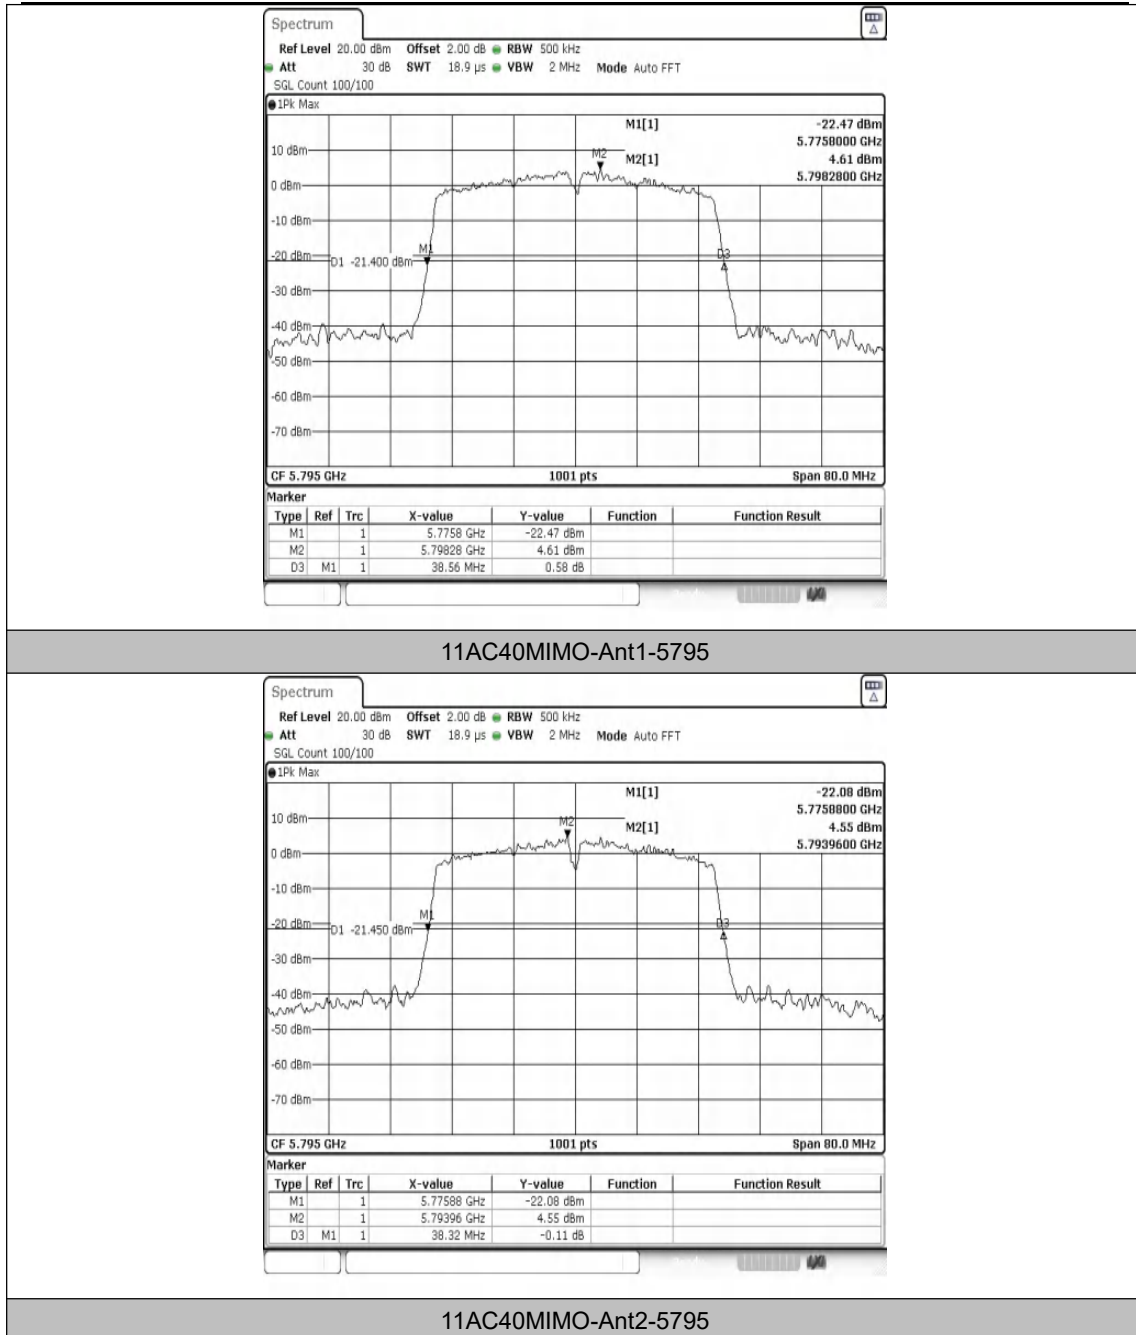

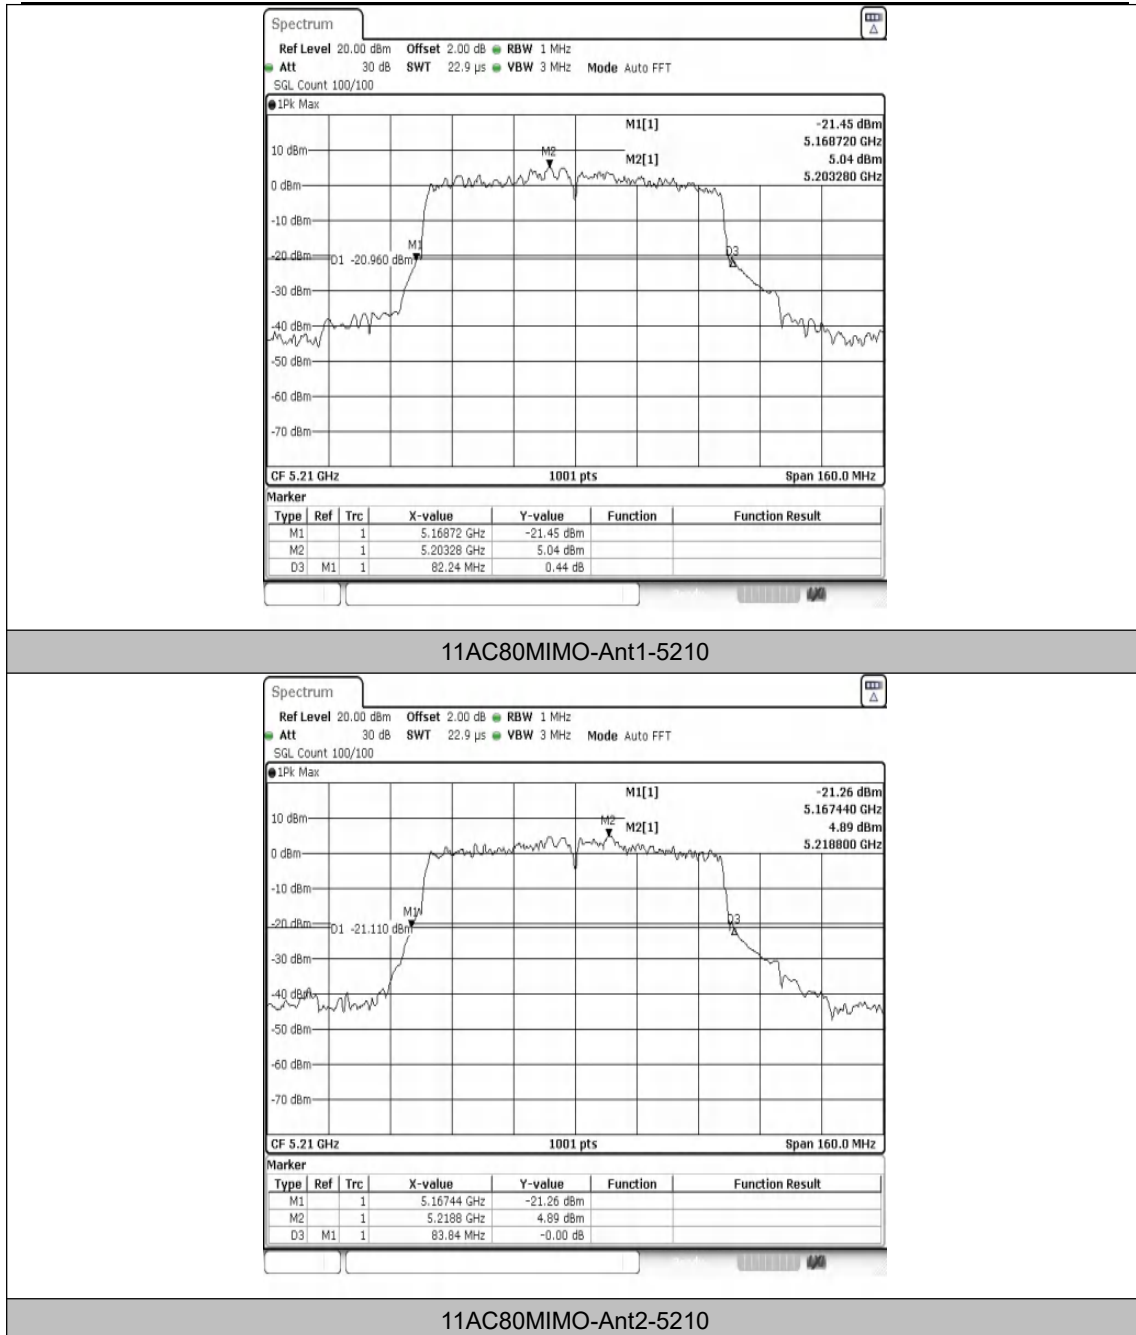

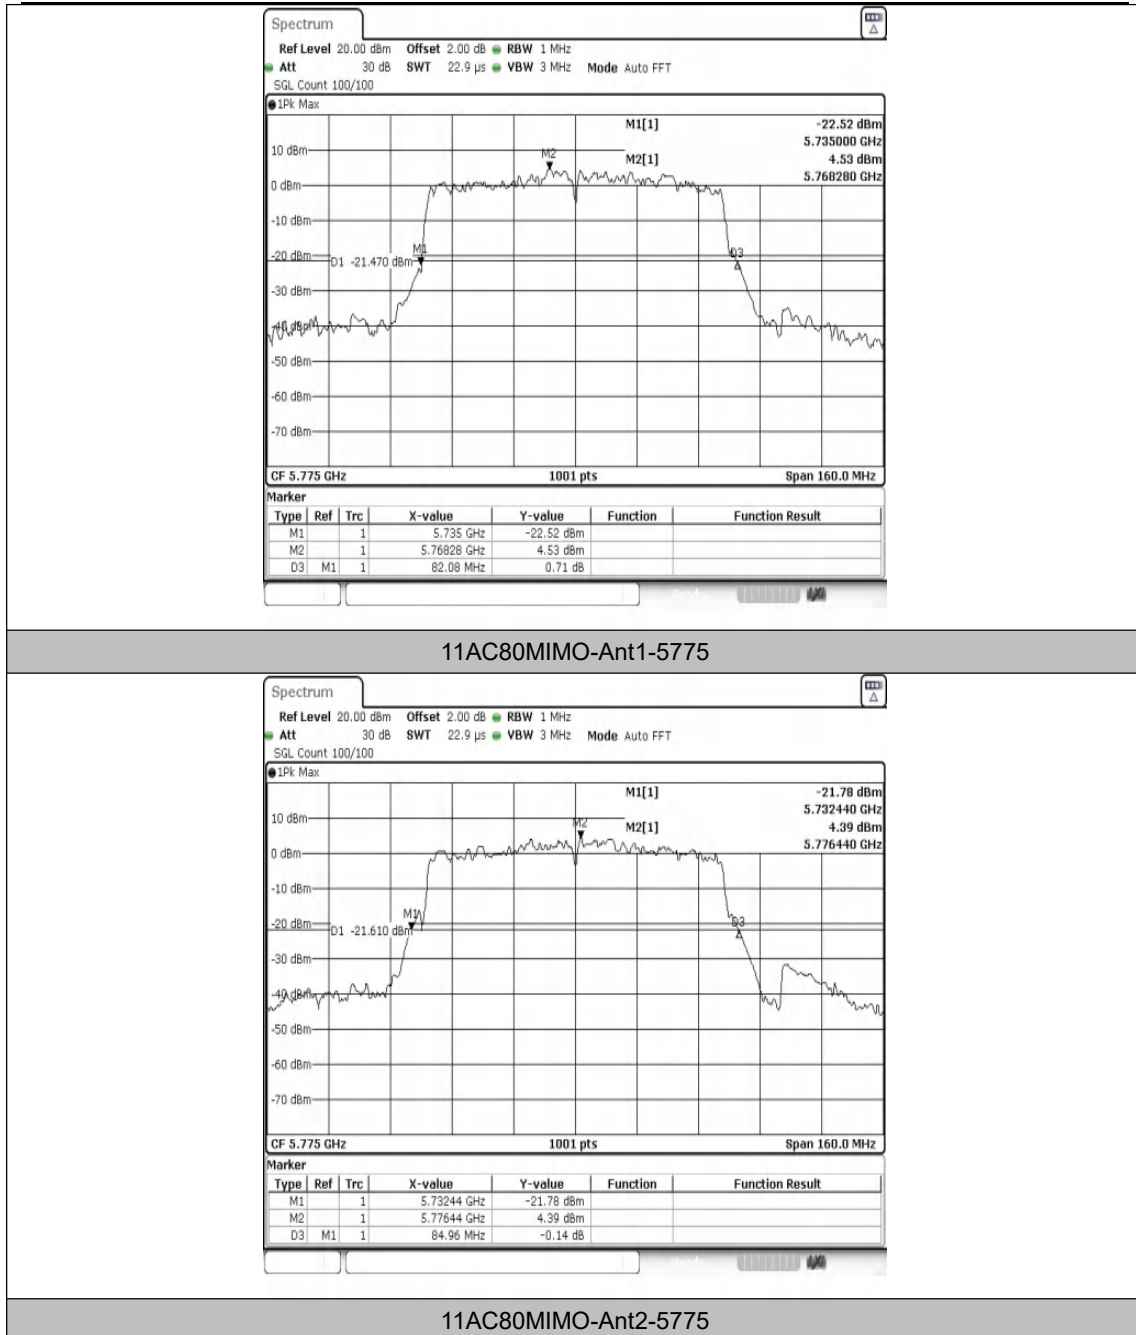

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	16.224	5171.8881	5188.1119	---	---
11A	Ant2	5180	16.184	5171.9281	5188.1119	---	---
11A	Ant1	5200	16.224	5191.8881	5208.1119	---	---
11A	Ant2	5200	16.224	5191.8881	5208.1119	---	---
11A	Ant1	5240	16.224	5231.8881	5248.1119	---	---
11A	Ant2	5240	16.224	5231.8881	5248.1119	---	---
11A	Ant1	5745	16.184	5736.8881	5753.0719	---	---
11A	Ant2	5745	16.264	5736.8881	5753.1518	---	---
11A	Ant1	5785	16.224	5776.8881	5793.1119	---	---
11A	Ant2	5785	16.184	5776.8881	5793.0719	---	---
11A	Ant1	5825	16.224	5816.8881	5833.1119	---	---
11A	Ant2	5825	16.264	5816.8482	5833.1119	---	---
11N20MIMO	Ant1	5180	17.303	5171.3686	5188.6713	---	---
11N20MIMO	Ant2	5180	17.303	5171.3686	5188.6713	---	---
11N20MIMO	Ant1	5200	17.343	5191.3287	5208.6713	---	---
11N20MIMO	Ant2	5200	17.343	5191.3287	5208.6713	---	---
11N20MIMO	Ant1	5240	17.303	5231.3686	5248.6713	---	---
11N20MIMO	Ant2	5240	17.303	5231.3686	5248.6713	---	---
11N20MIMO	Ant1	5745	17.343	5736.3287	5753.6713	---	---
11N20MIMO	Ant2	5745	17.303	5736.3287	5753.6314	---	---
11N20MIMO	Ant1	5785	17.303	5776.3287	5793.6314	---	---
11N20MIMO	Ant2	5785	17.343	5776.3287	5793.6713	---	---
11N20MIMO	Ant1	5825	17.303	5816.3287	5833.6314	---	---
11N20MIMO	Ant2	5825	17.303	5816.3287	5833.6314	---	---
11N40MIMO	Ant1	5190	35.724	5172.0979	5207.8222	---	---
11N40MIMO	Ant2	5190	35.724	5172.0979	5207.8222	---	---
11N40MIMO	Ant1	5230	35.724	5212.0979	5247.8222	---	---
11N40MIMO	Ant2	5230	35.804	5212.0180	5247.8222	---	---
11N40MIMO	Ant1	5755	35.724	5737.0180	5772.7423	---	---
11N40MIMO	Ant2	5755	35.644	5737.0979	5772.7423	---	---
11N40MIMO	Ant1	5795	35.724	5777.0180	5812.7423	---	---
11N40MIMO	Ant2	5795	35.724	5777.0180	5812.7423	---	---
11AC20MIMO	Ant1	5180	17.383	5171.2887	5188.6713	---	---
11AC20MIMO	Ant2	5180	17.383	5171.2887	5188.6713	---	---
11AC20MIMO	Ant1	5200	17.423	5191.2887	5208.7113	---	---
11AC20MIMO	Ant2	5200	17.383	5191.2887	5208.6713	---	---
11AC20MIMO	Ant1	5240	17.383	5231.2887	5248.6713	---	---

11AC20MIMO	Ant2	5240	17.383	5231.3287	5248.7113	---	---
11AC20MIMO	Ant1	5745	17.423	5736.2488	5753.6713	---	---
11AC20MIMO	Ant2	5745	17.383	5736.2887	5753.6713	---	---
11AC20MIMO	Ant1	5785	17.463	5776.2488	5793.7113	---	---
11AC20MIMO	Ant2	5785	17.383	5776.2887	5793.6713	---	---
11AC20MIMO	Ant1	5825	17.423	5816.2488	5833.6713	---	---
11AC20MIMO	Ant2	5825	17.303	5816.2887	5833.5914	---	---
11AC40MIMO	Ant1	5190	35.485	5172.2577	5207.7423	---	---
11AC40MIMO	Ant2	5190	35.485	5172.2577	5207.7423	---	---
11AC40MIMO	Ant1	5230	35.564	5212.1778	5247.7423	---	---
11AC40MIMO	Ant2	5230	35.485	5212.2577	5247.7423	---	---
11AC40MIMO	Ant1	5755	35.405	5737.2577	5772.6623	---	---
11AC40MIMO	Ant2	5755	35.485	5737.1778	5772.6623	---	---
11AC40MIMO	Ant1	5795	35.405	5777.2577	5812.6623	---	---
11AC40MIMO	Ant2	5795	35.405	5777.2577	5812.6623	---	---
11AC80MIMO	Ant1	5210	75.604	5172.1179	5247.7223	---	---
11AC80MIMO	Ant2	5210	75.604	5172.1179	5247.7223	---	---
11AC80MIMO	Ant1	5775	76.084	5736.7982	5812.8821	---	---
11AC80MIMO	Ant2	5775	75.924	5736.7982	5812.7223	---	---


Test Graphs

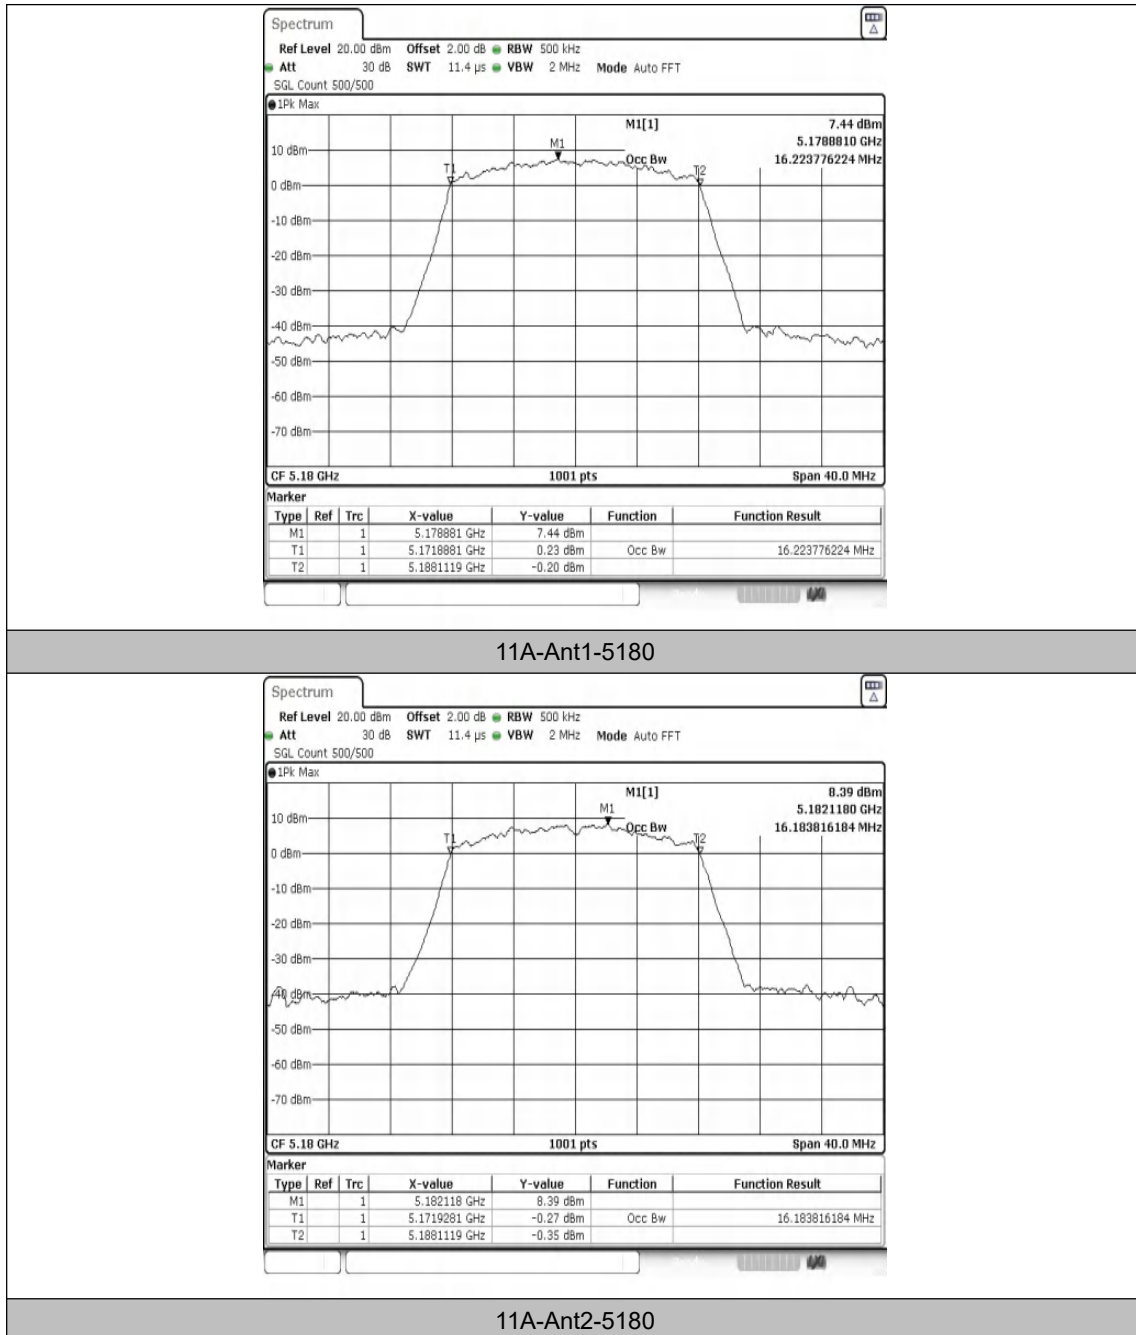


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

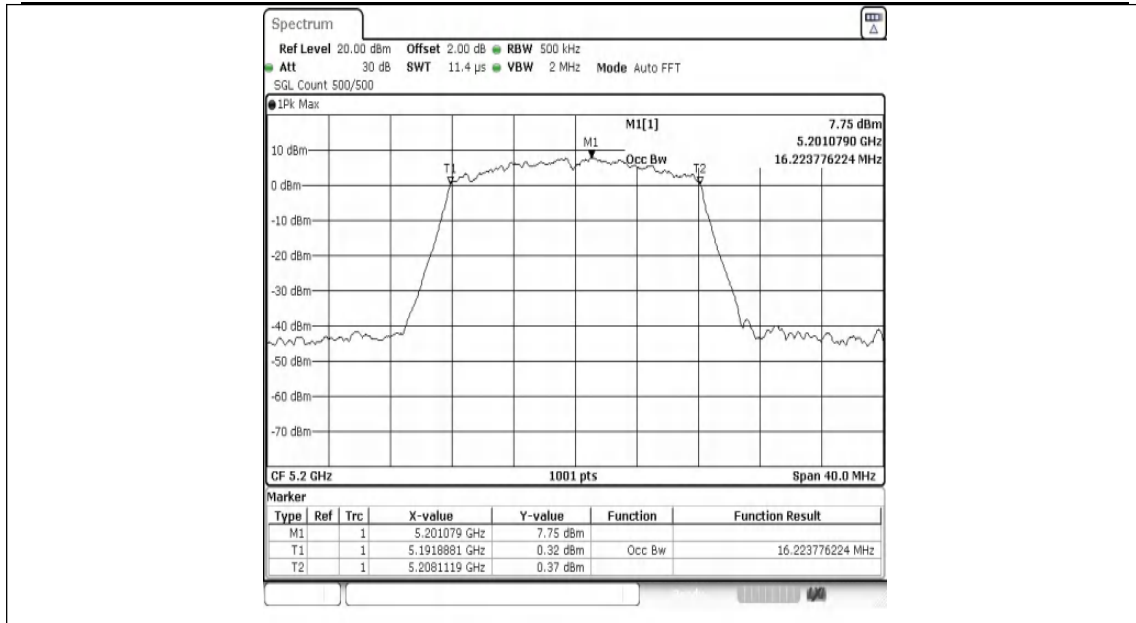


11A-Ant1-5200

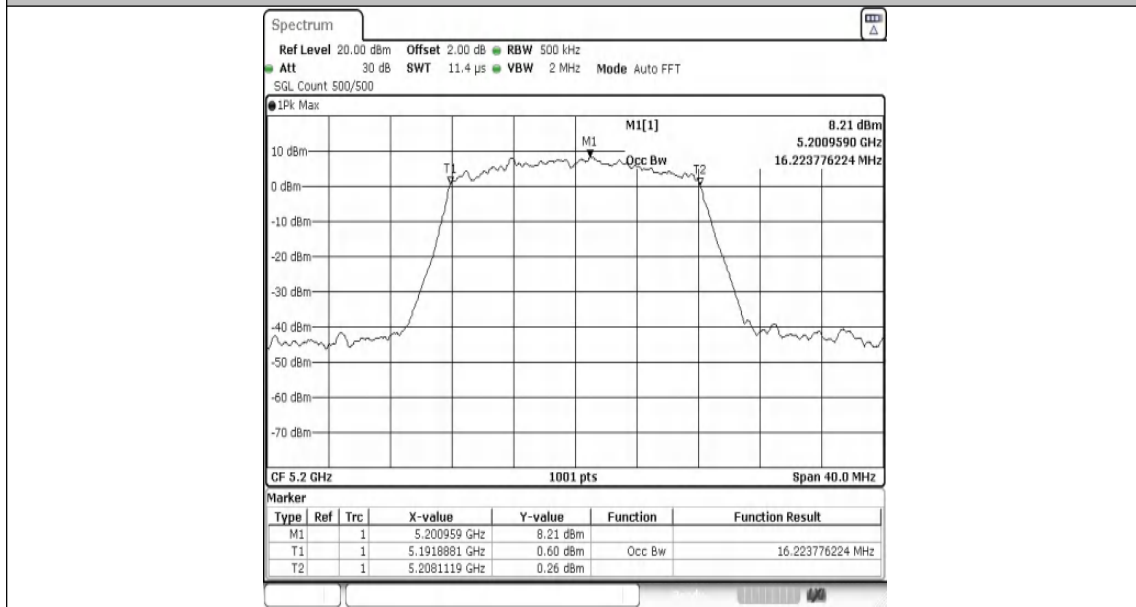


11A-Ant2-5200

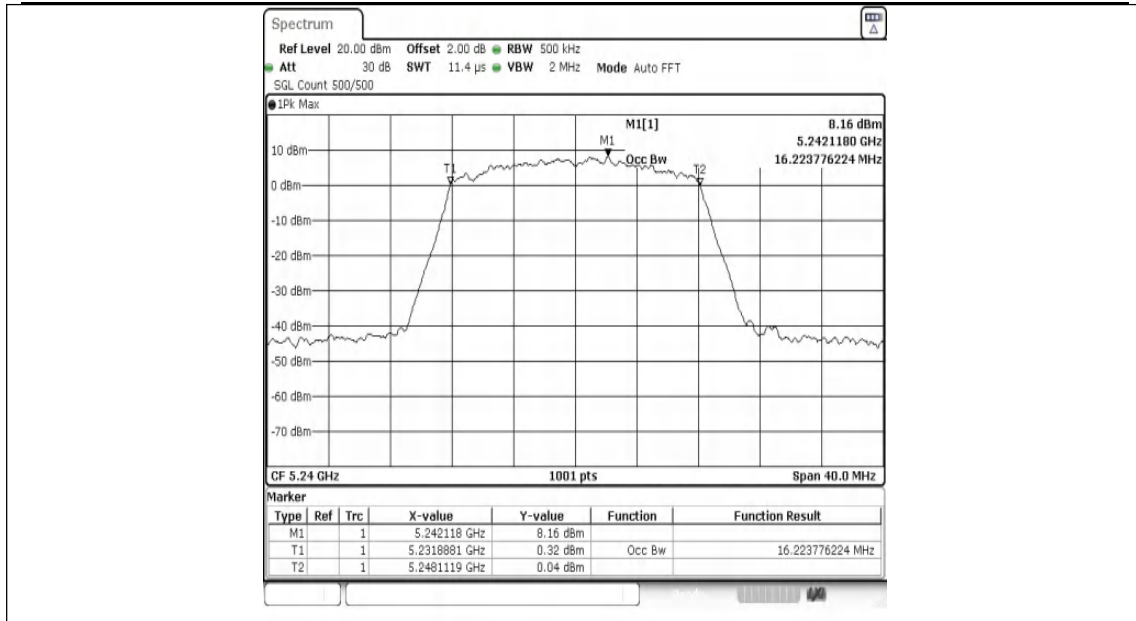


11A-Ant1-5240

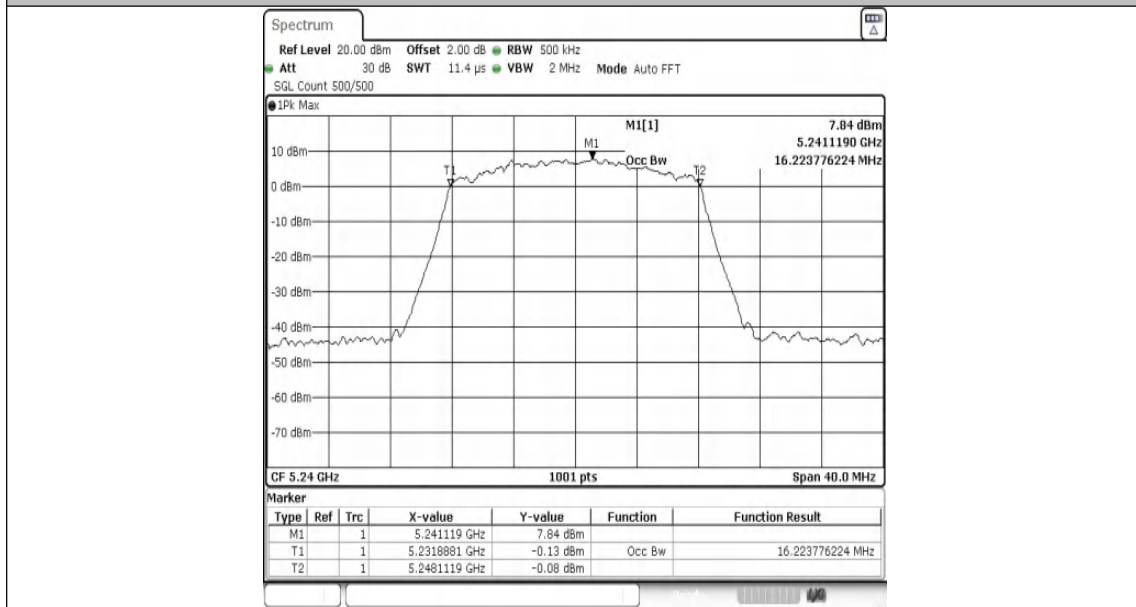


11A-Ant2-5240

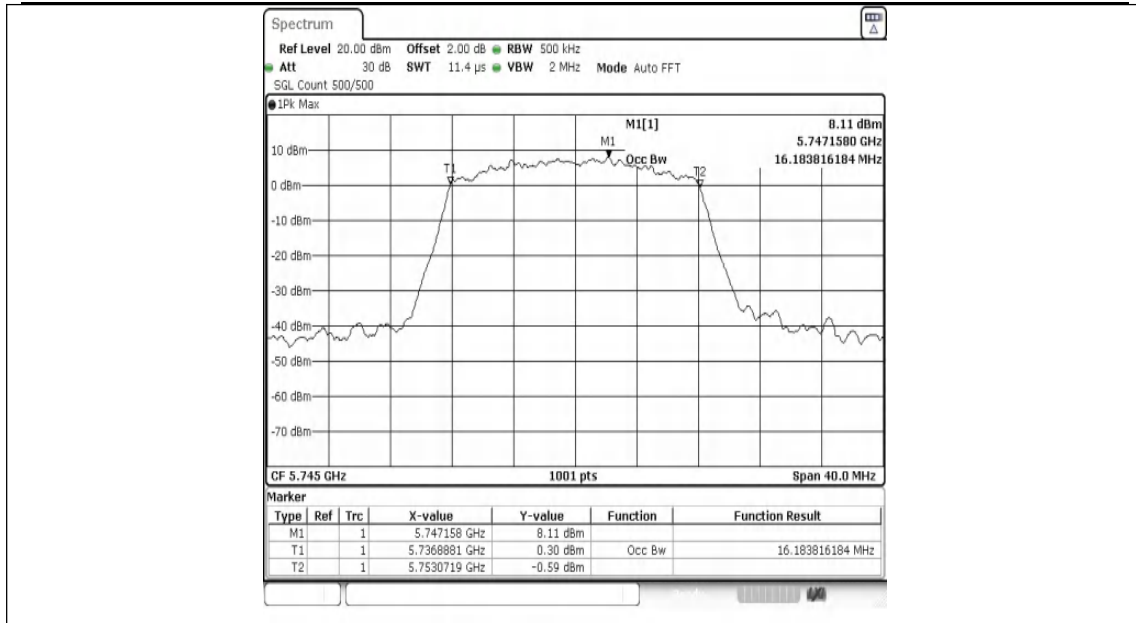



11A-Ant1-5745

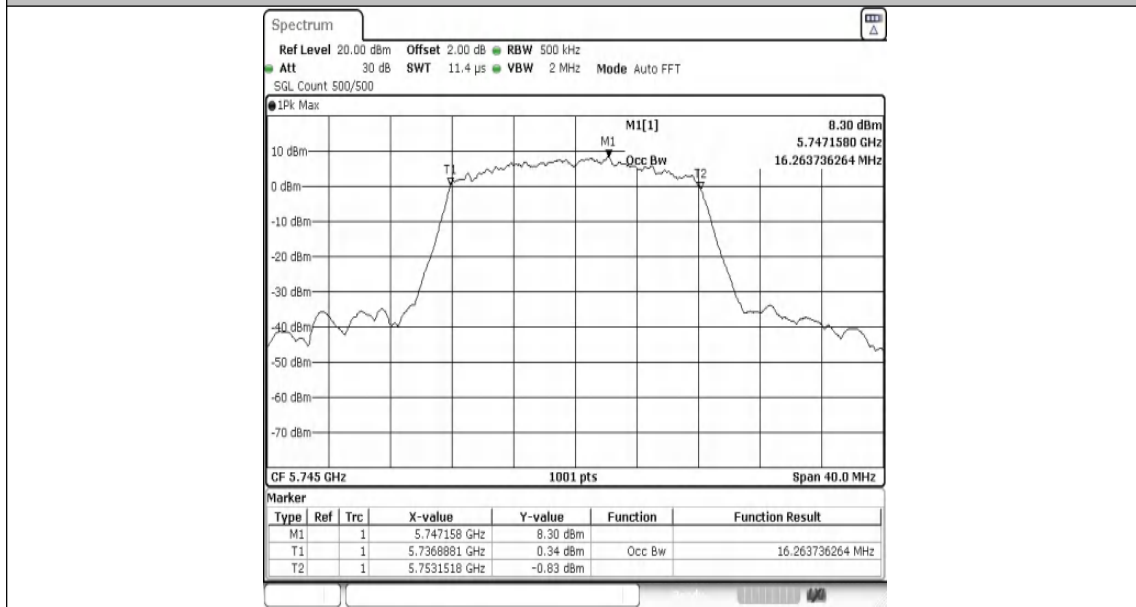


11A-Ant2-5745

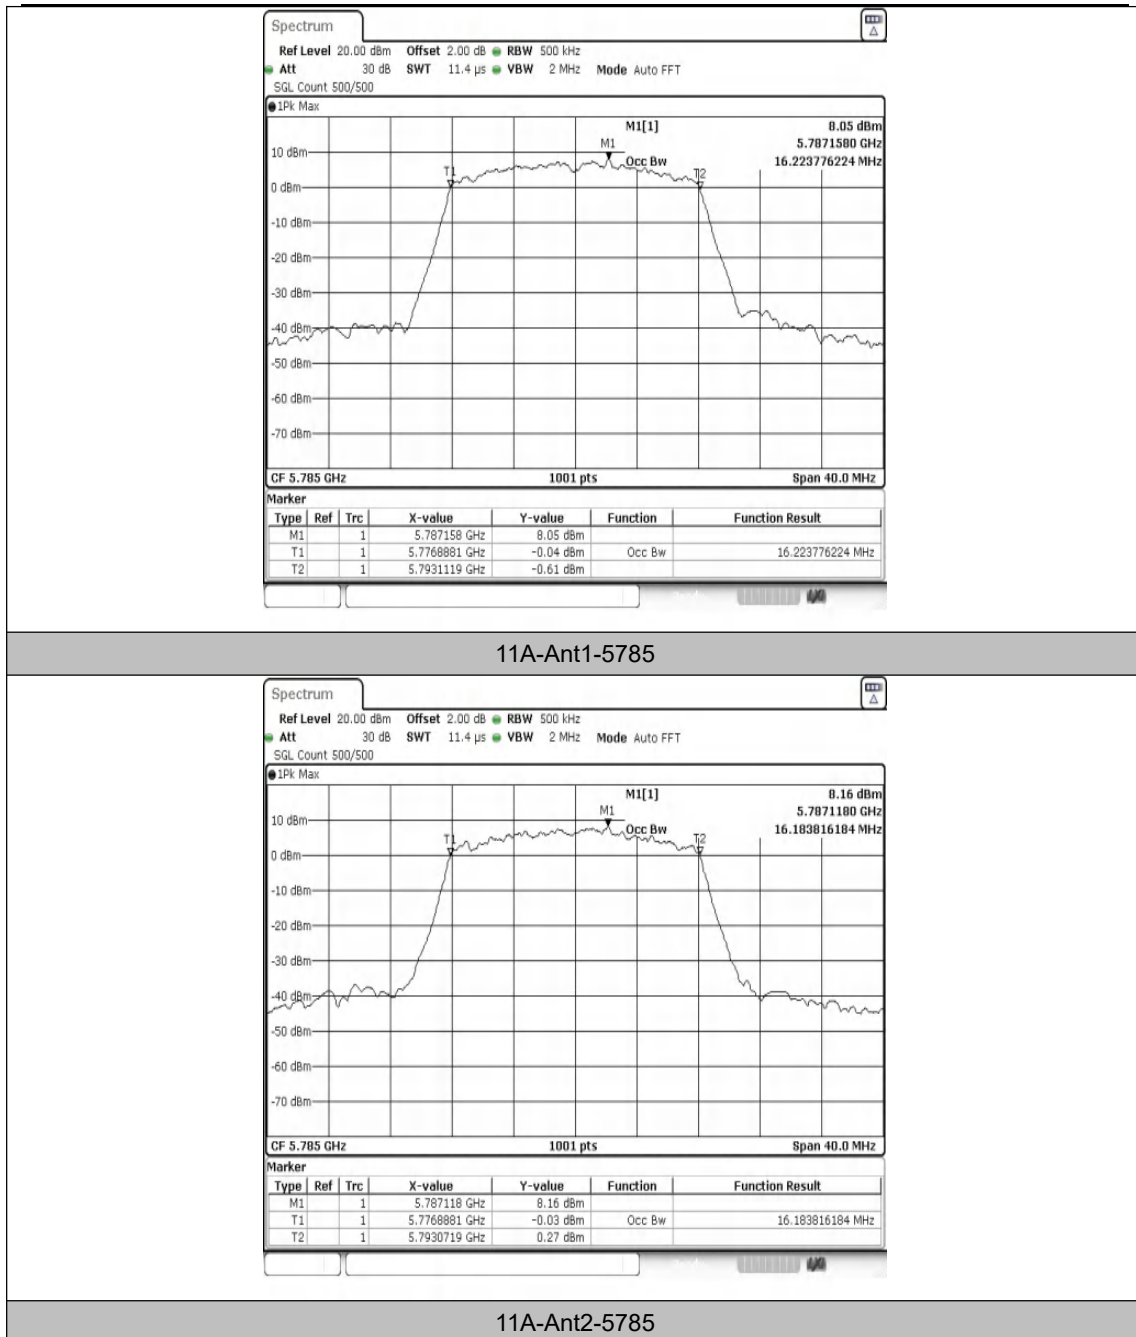

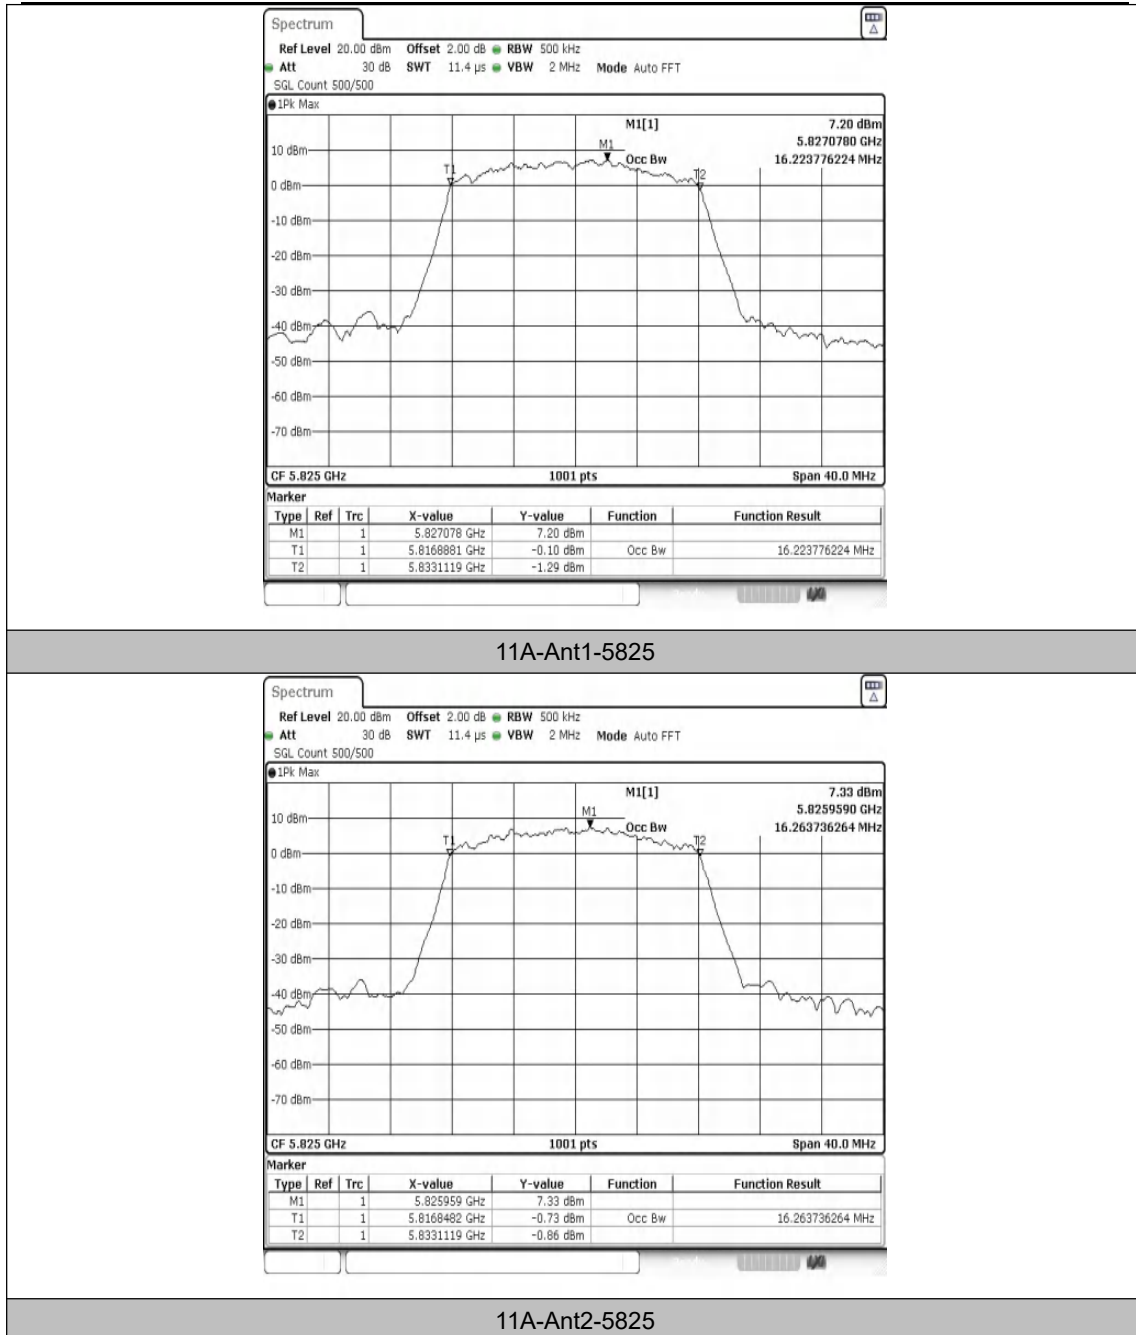


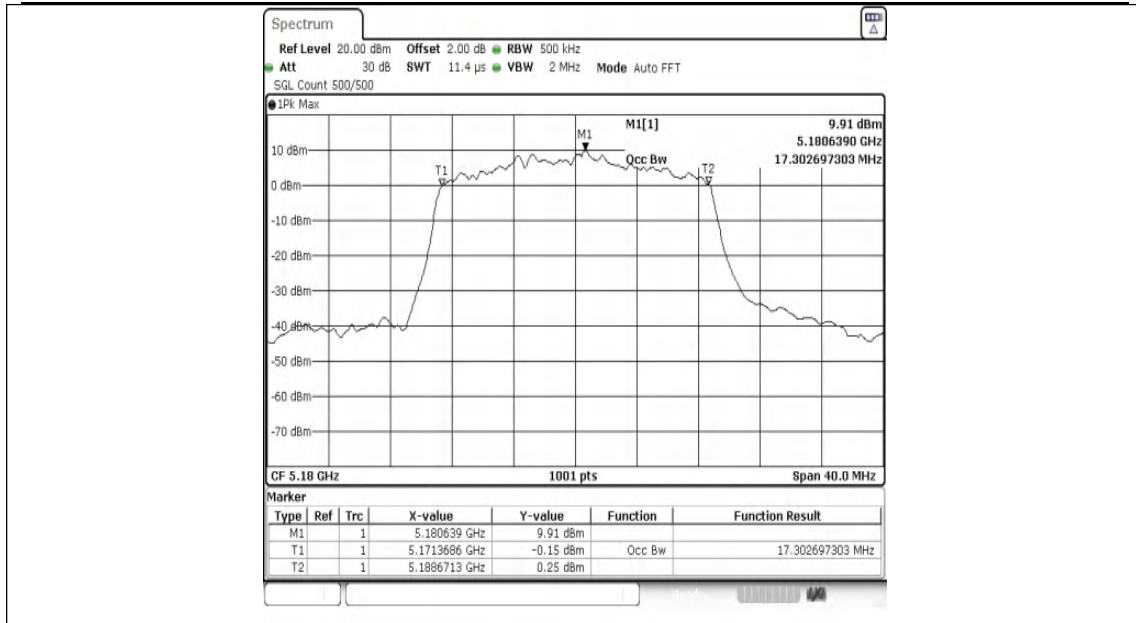


11N20MIMO-Ant1-5180

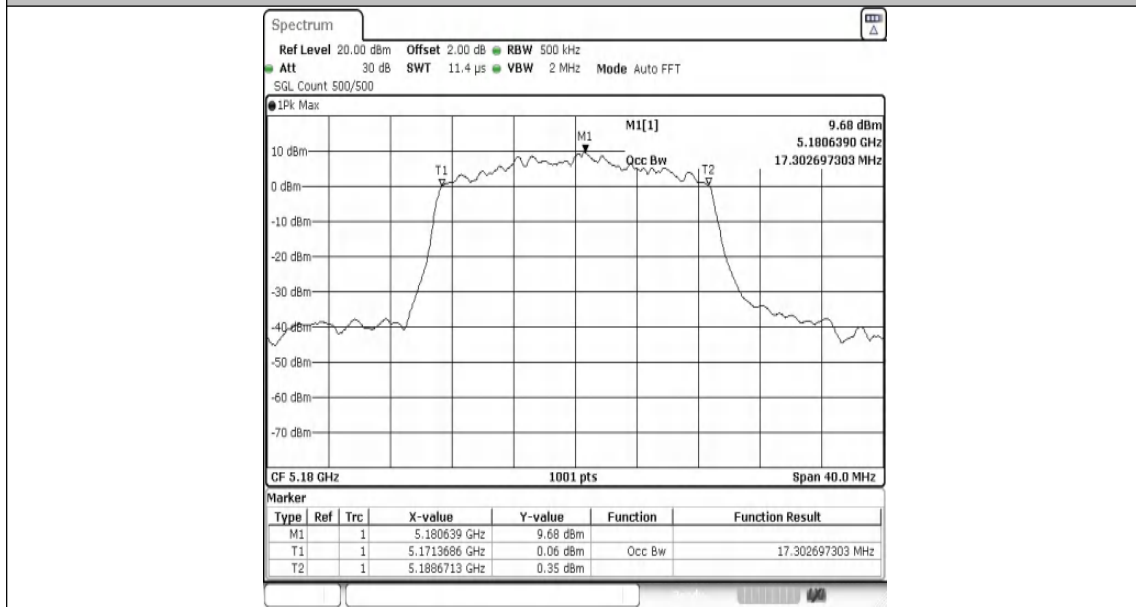


11N20MIMO-Ant2-5180

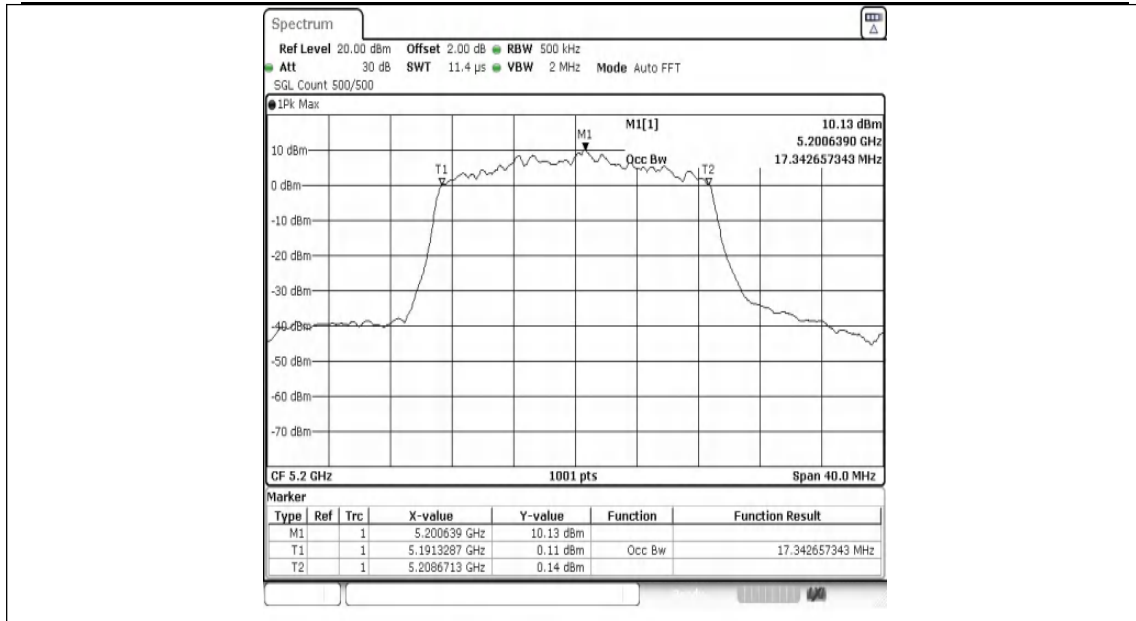


11N20MIMO-Ant1-5200

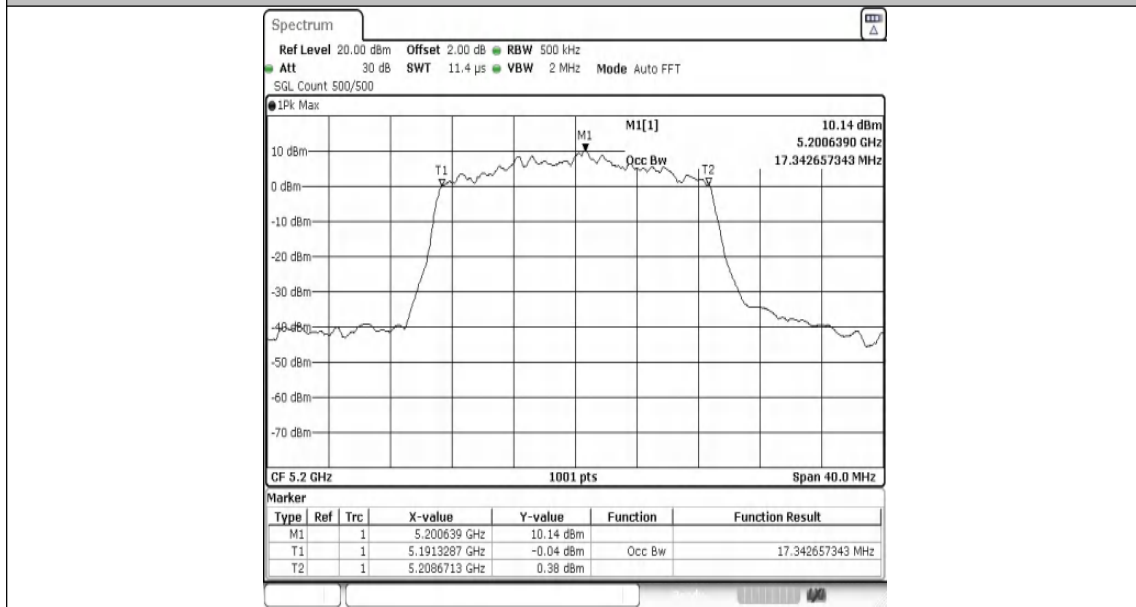


11N20MIMO-Ant2-5200

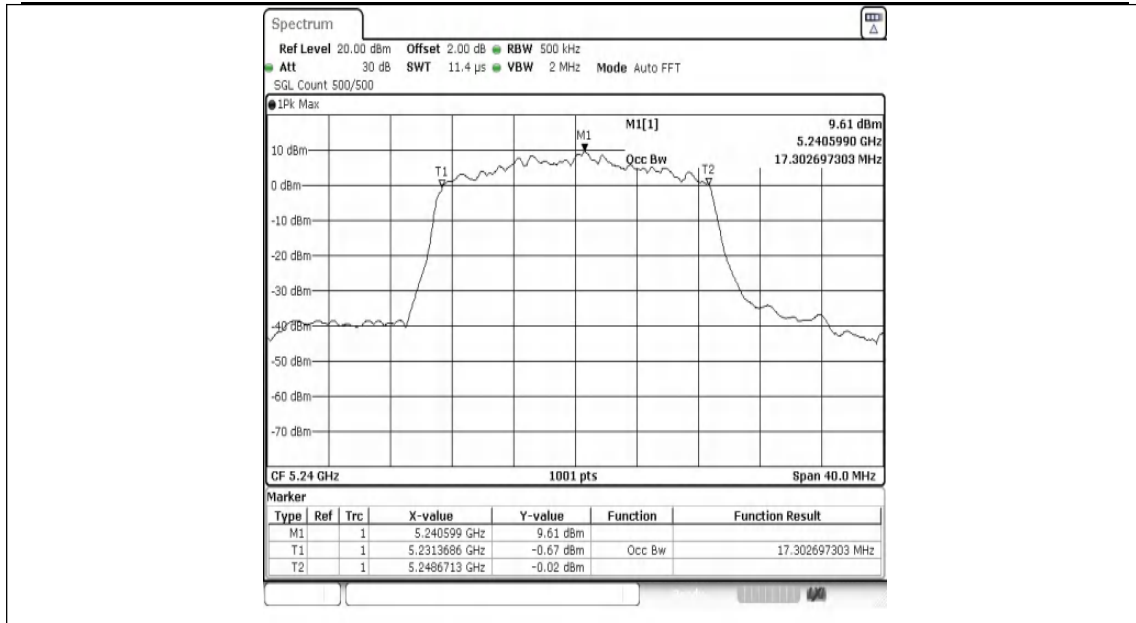


11N20MIMO-Ant1-5240

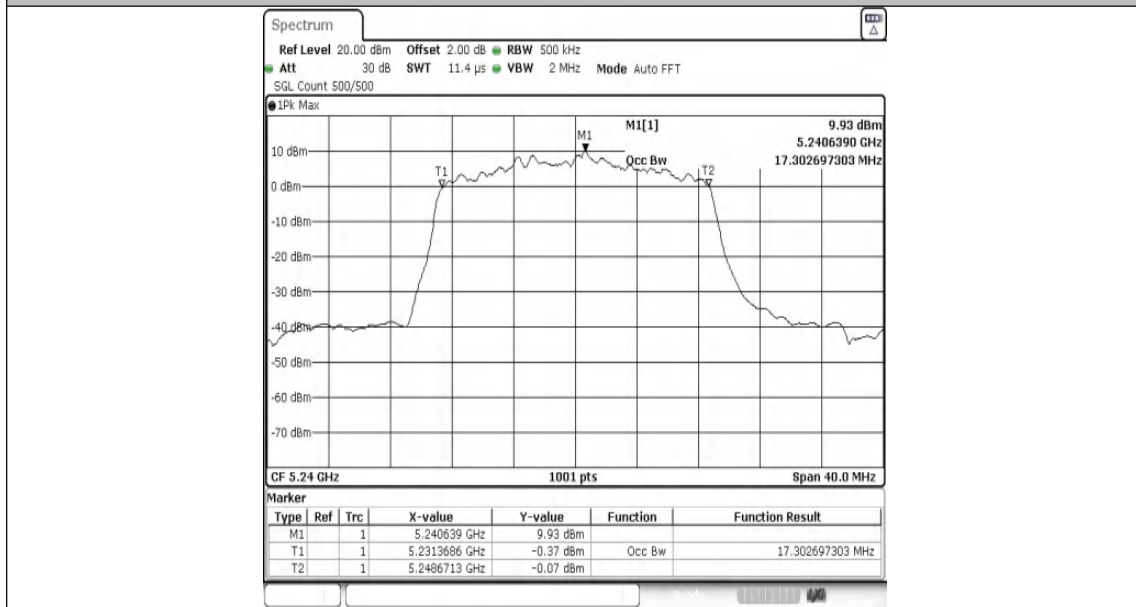


11N20MIMO-Ant2-5240

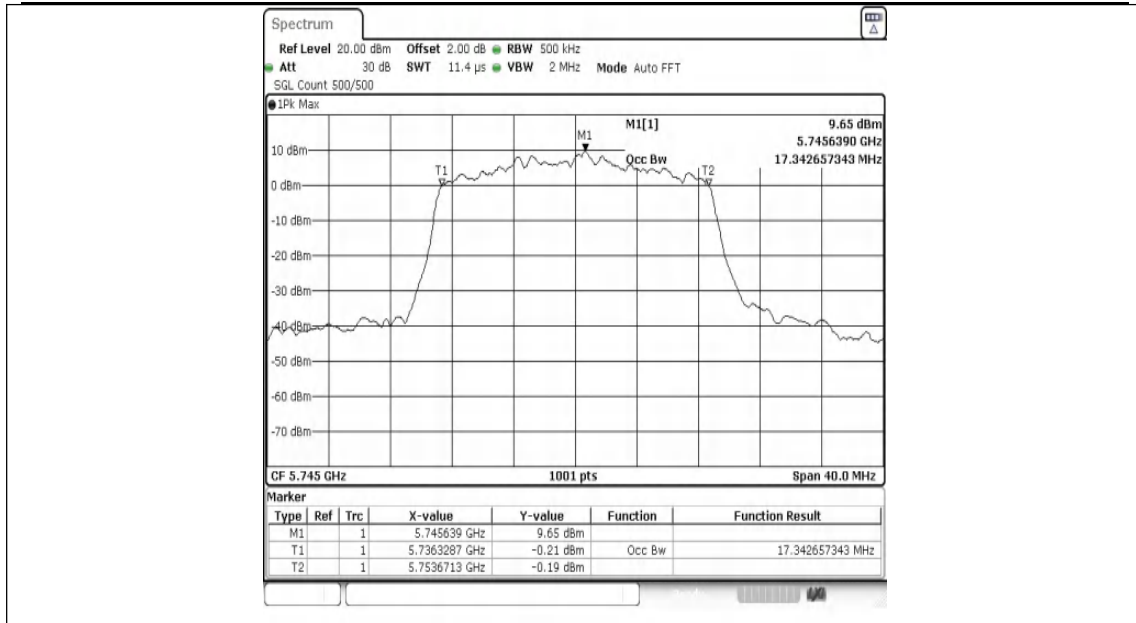


11N20MIMO-Ant1-5745

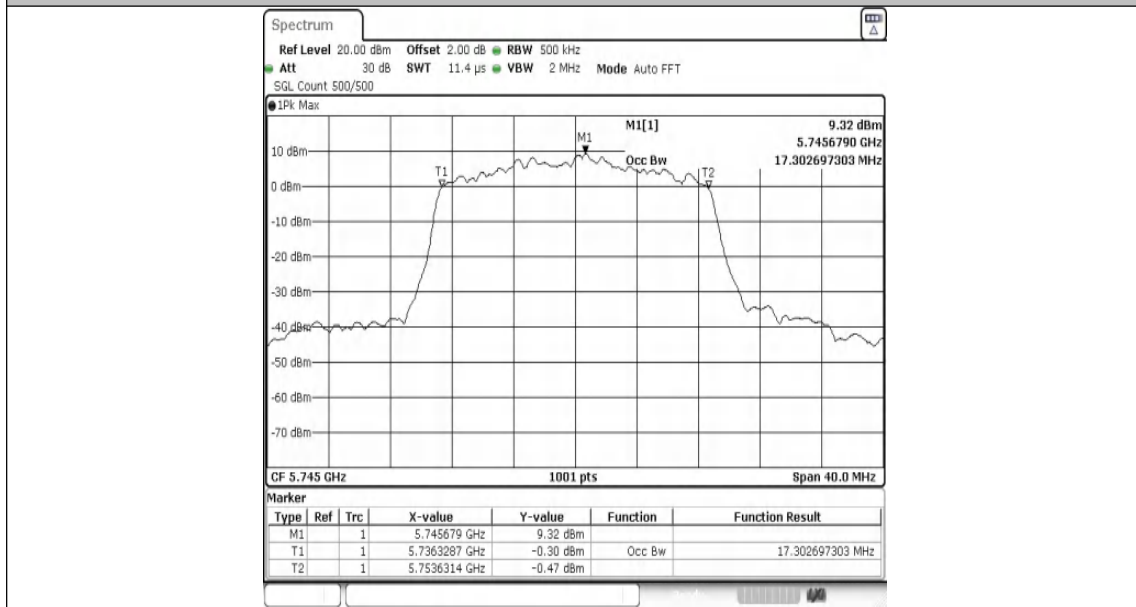


11N20MIMO-Ant2-5745

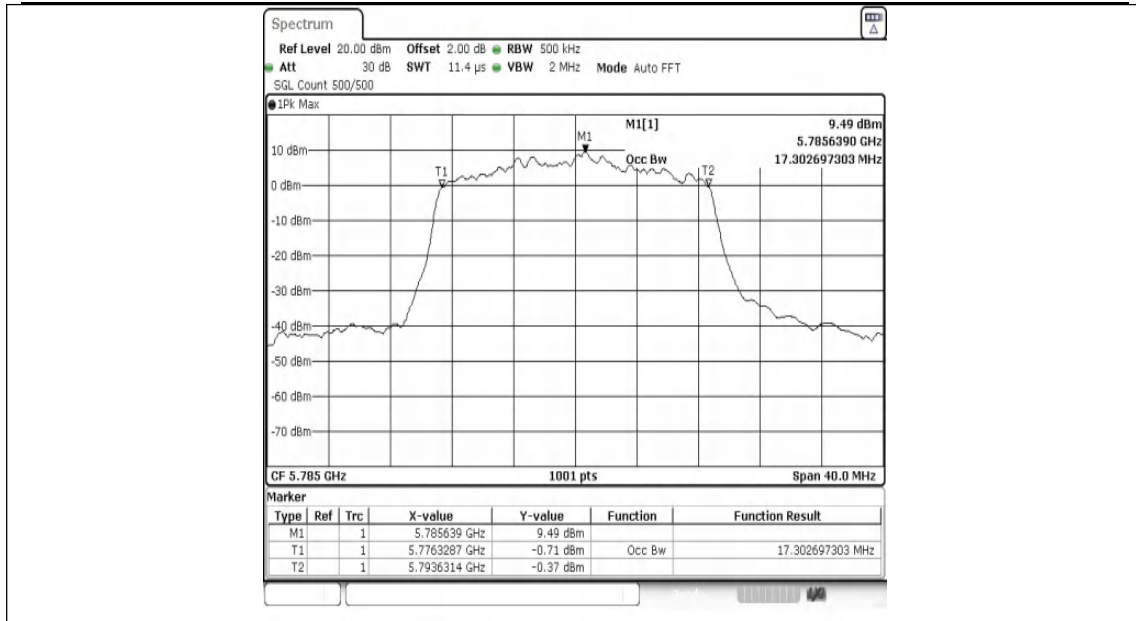


11N20MIMO-Ant1-5785

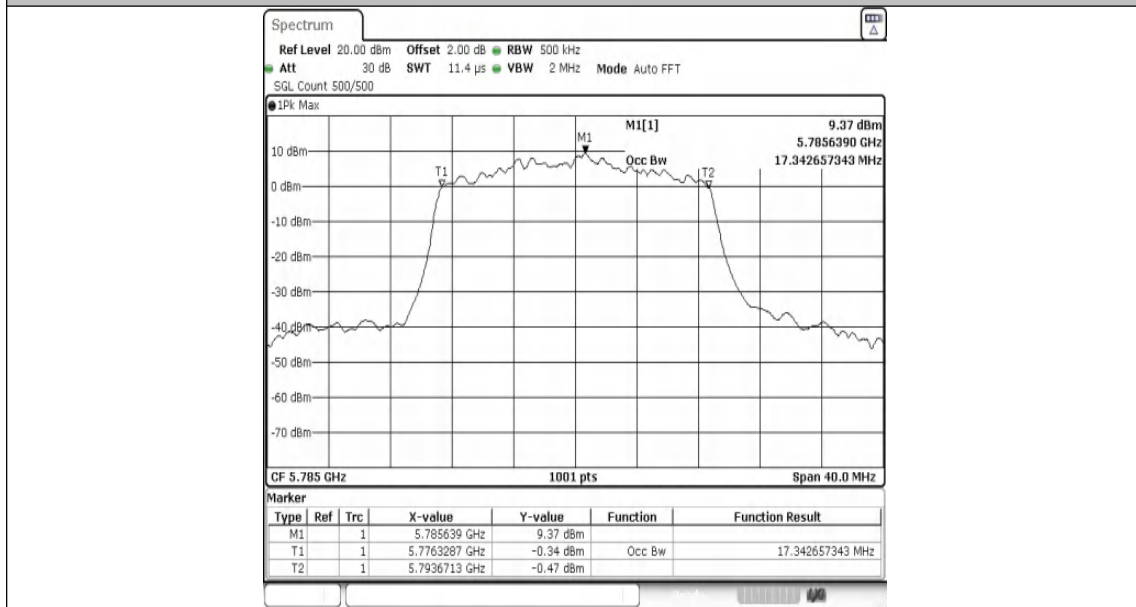


11N20MIMO-Ant2-5785

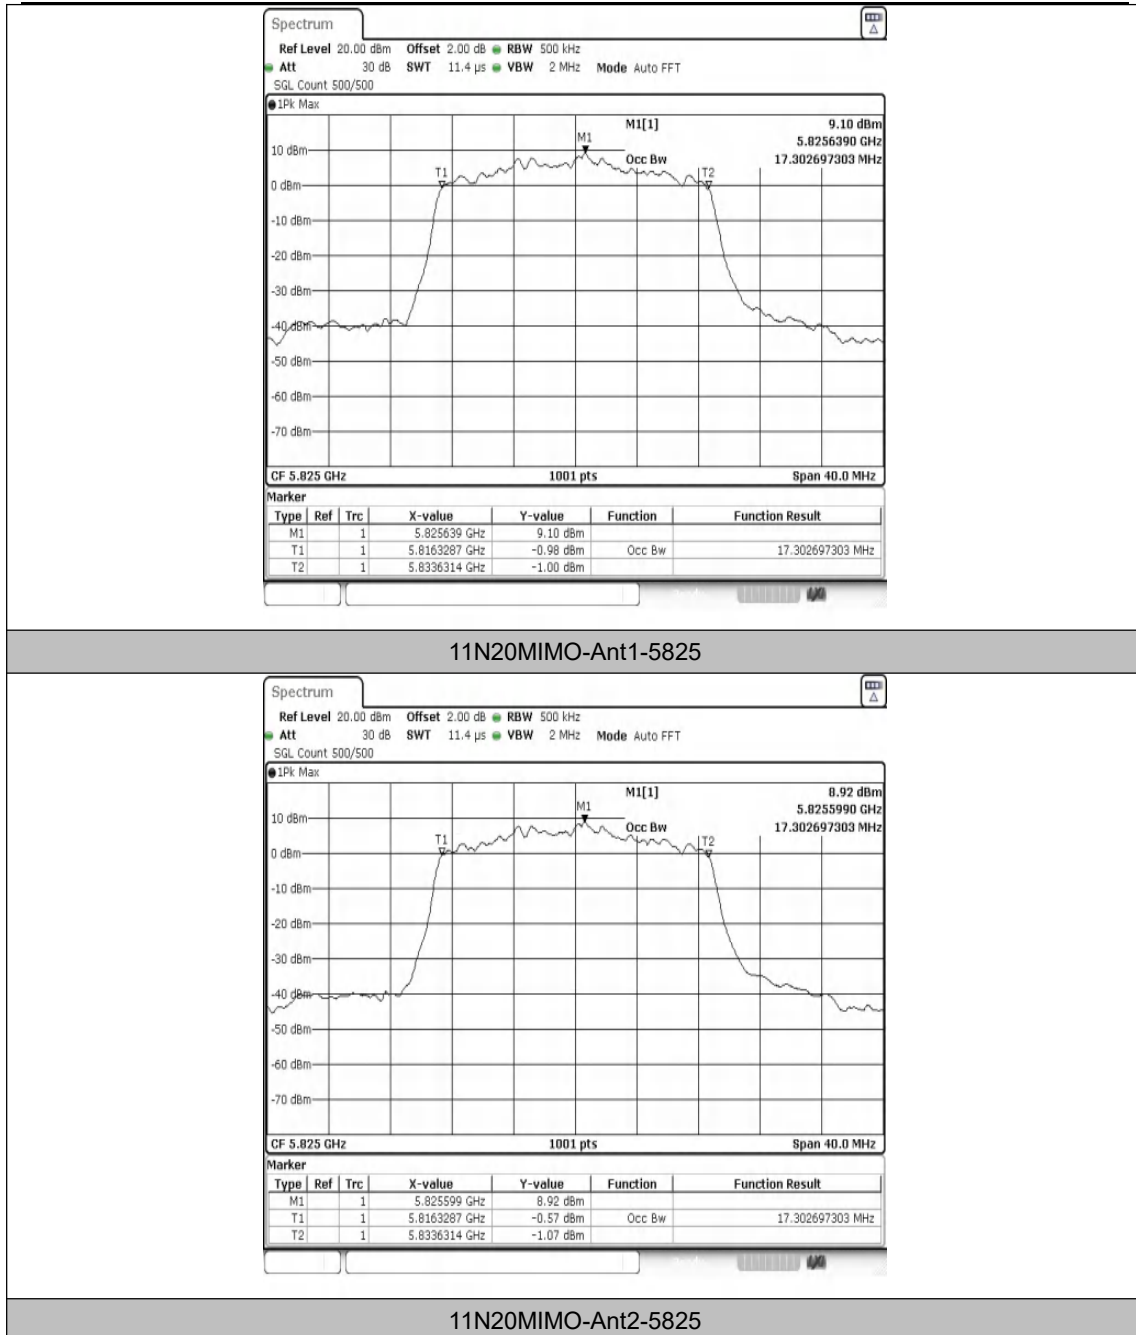


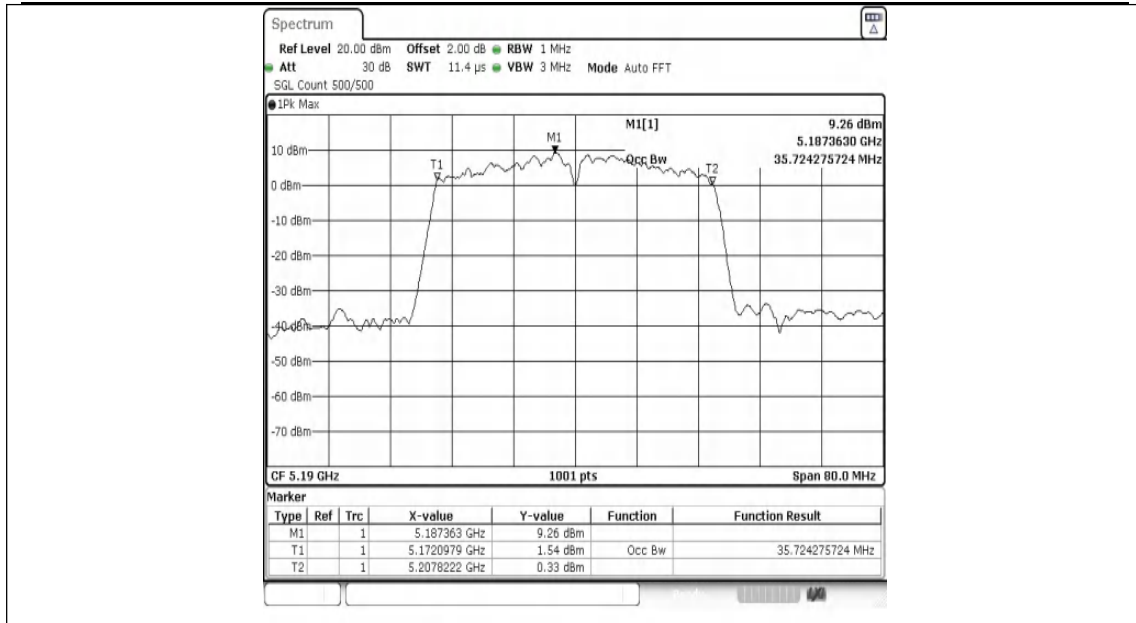


11N40MIMO-Ant1-5190

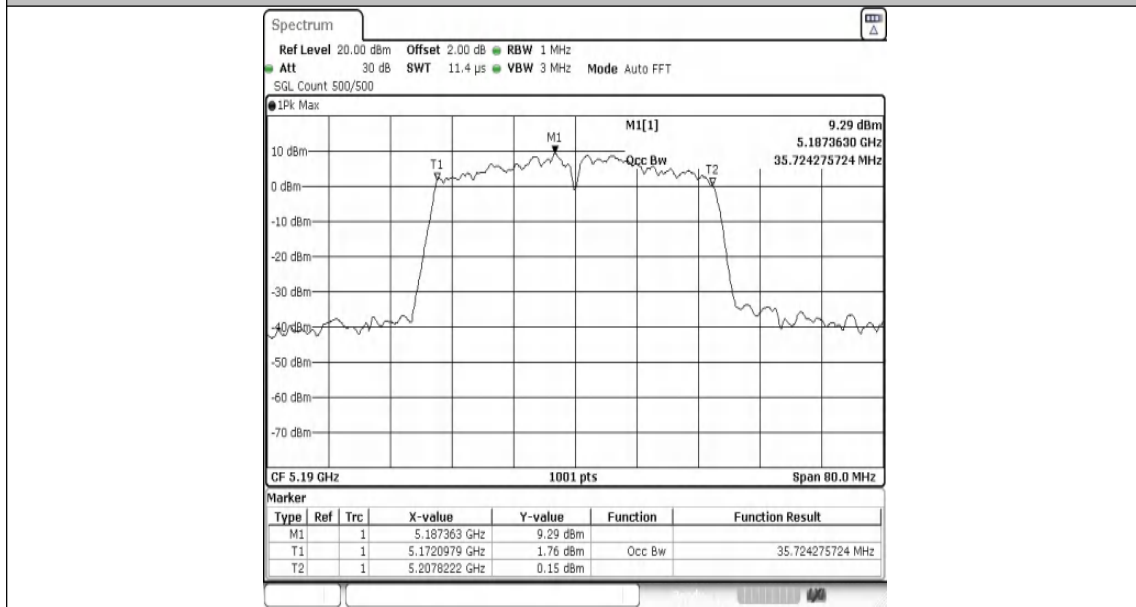


11N40MIMO-Ant2-5190

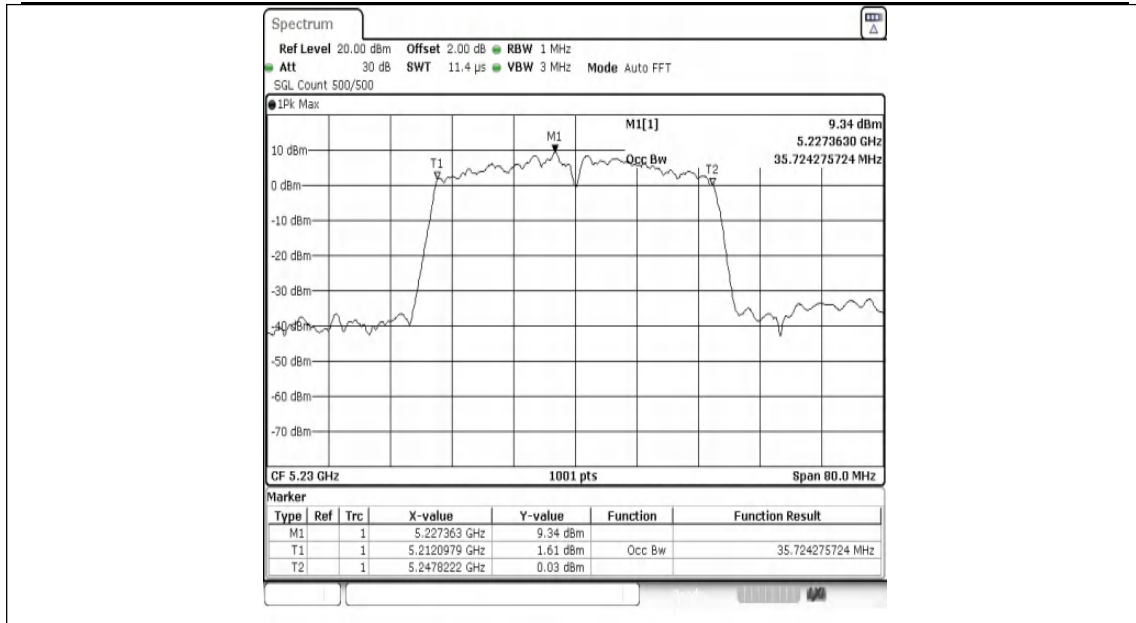


11N40MIMO-Ant1-5230

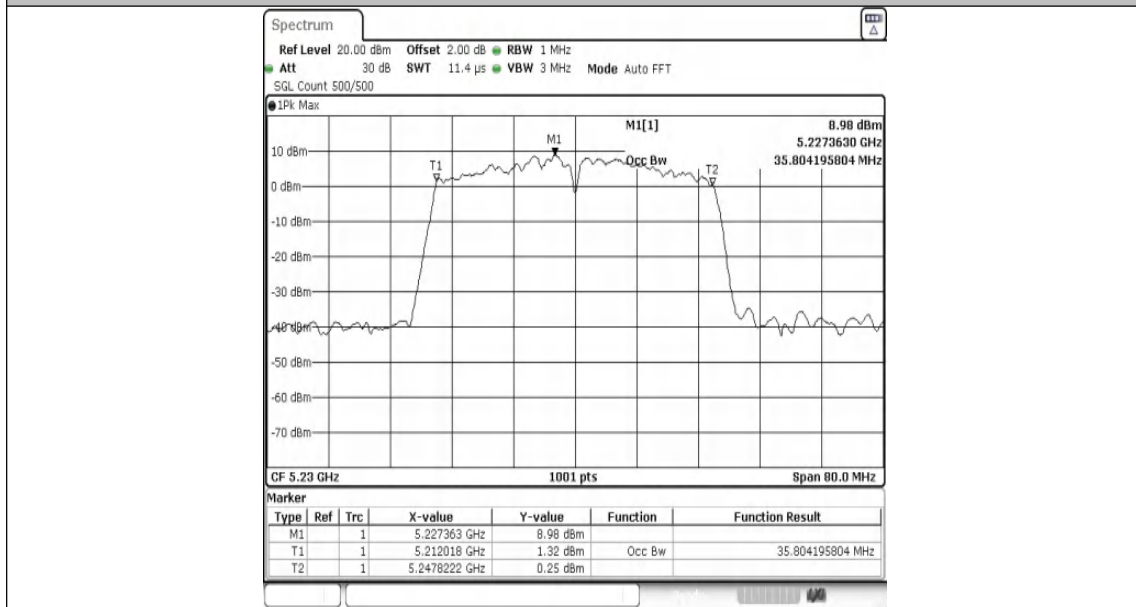


11N40MIMO-Ant2-5230

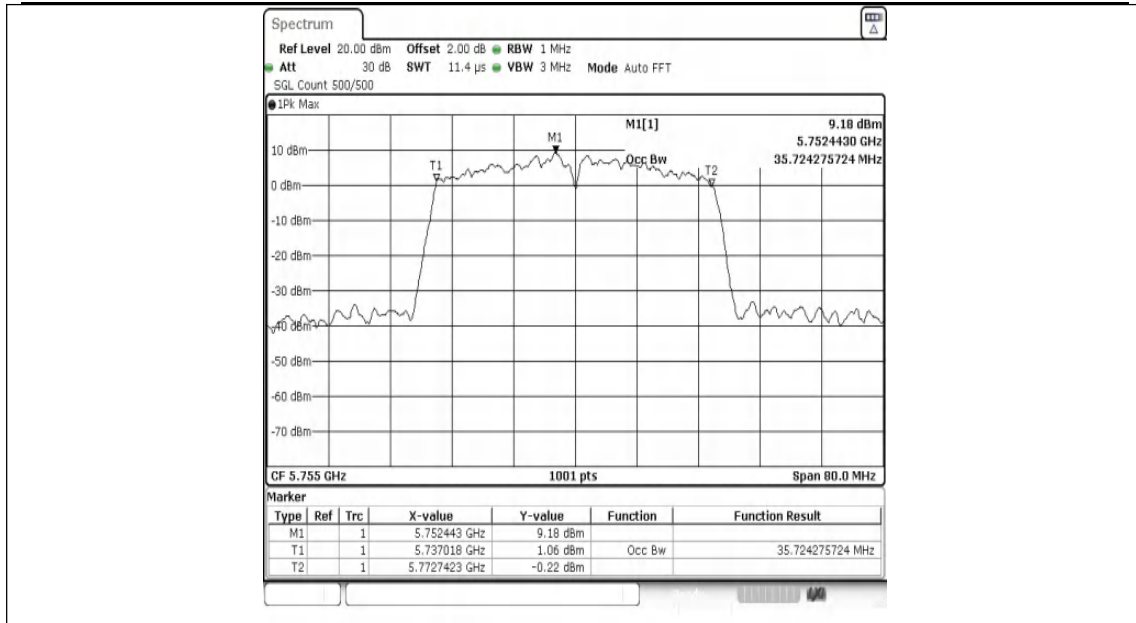


11N40MIMO-Ant1-5755

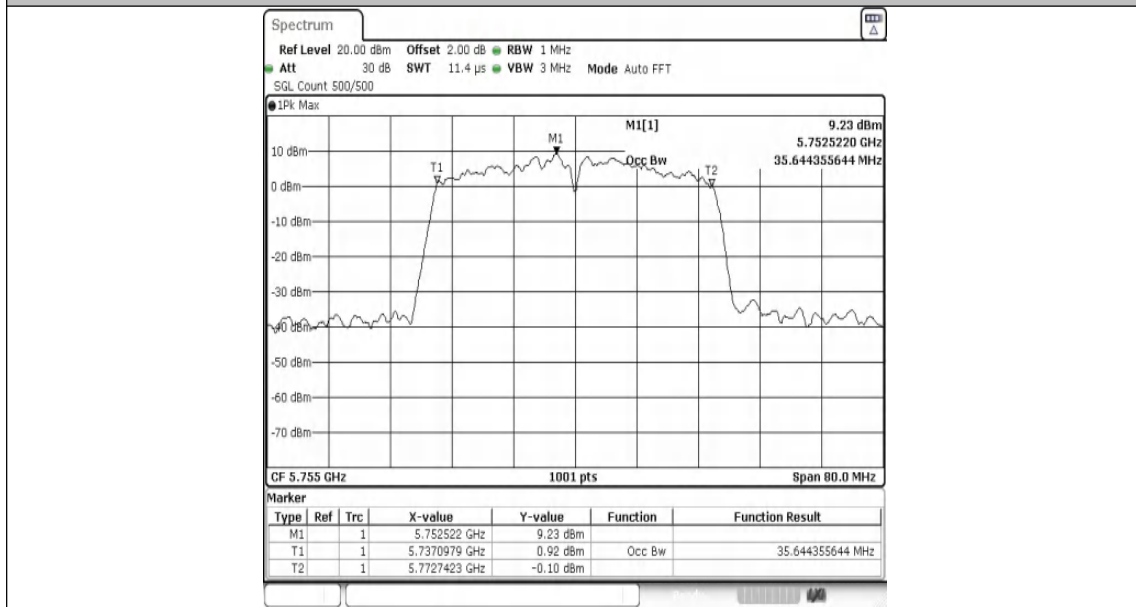


11N40MIMO-Ant2-5755

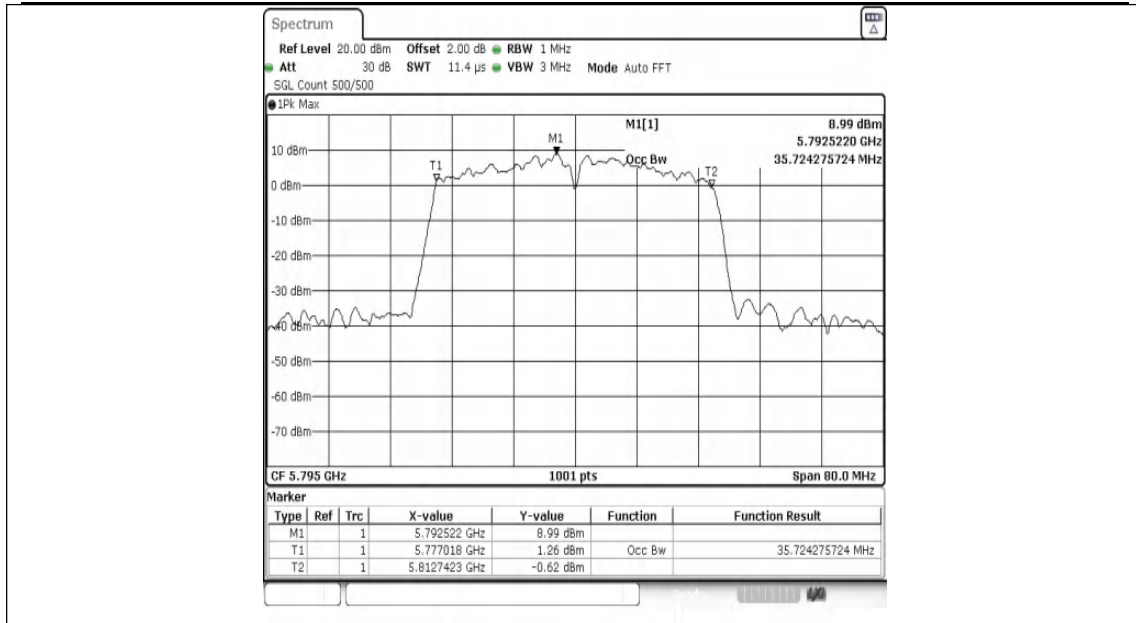



11N40MIMO-Ant1-5795

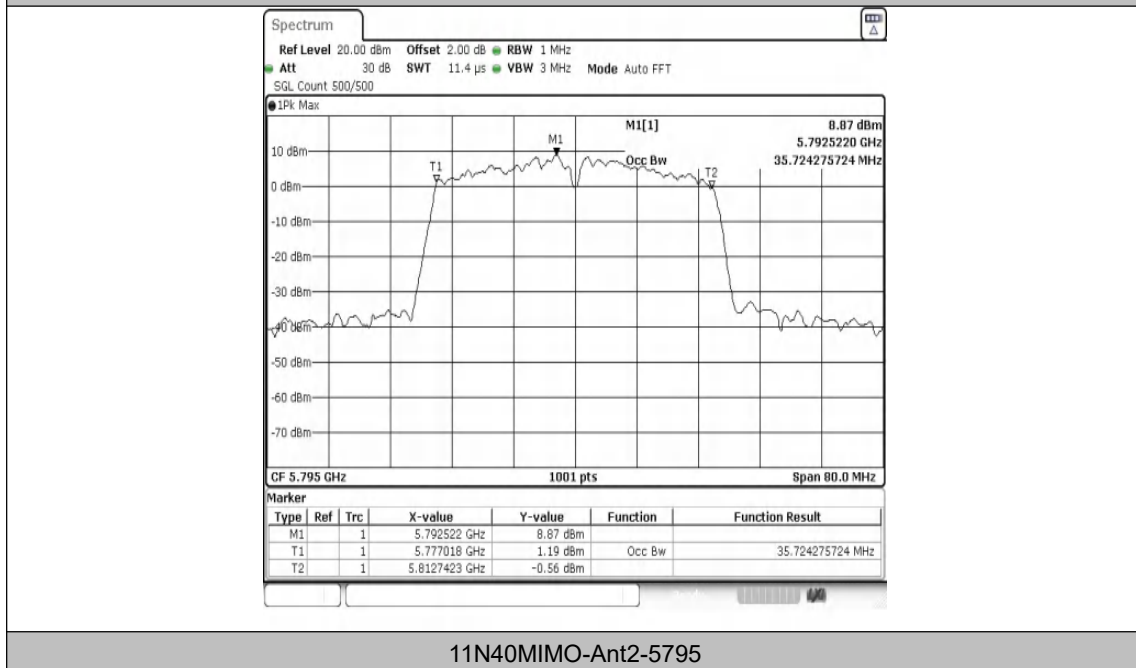


11N40MIMO-Ant2-5795

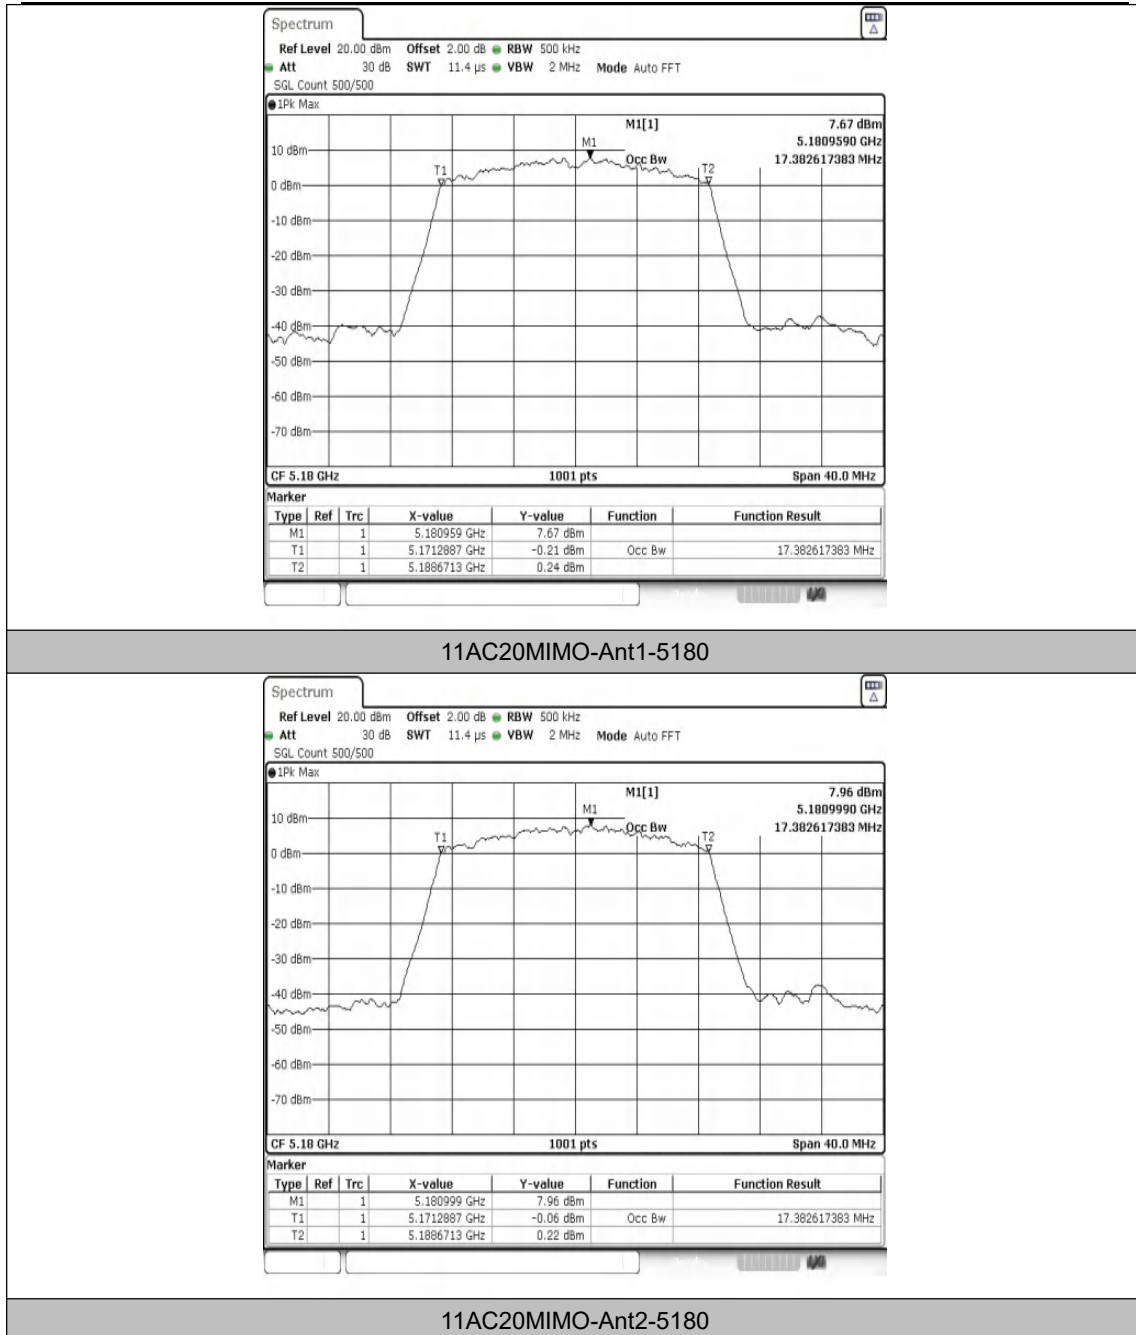

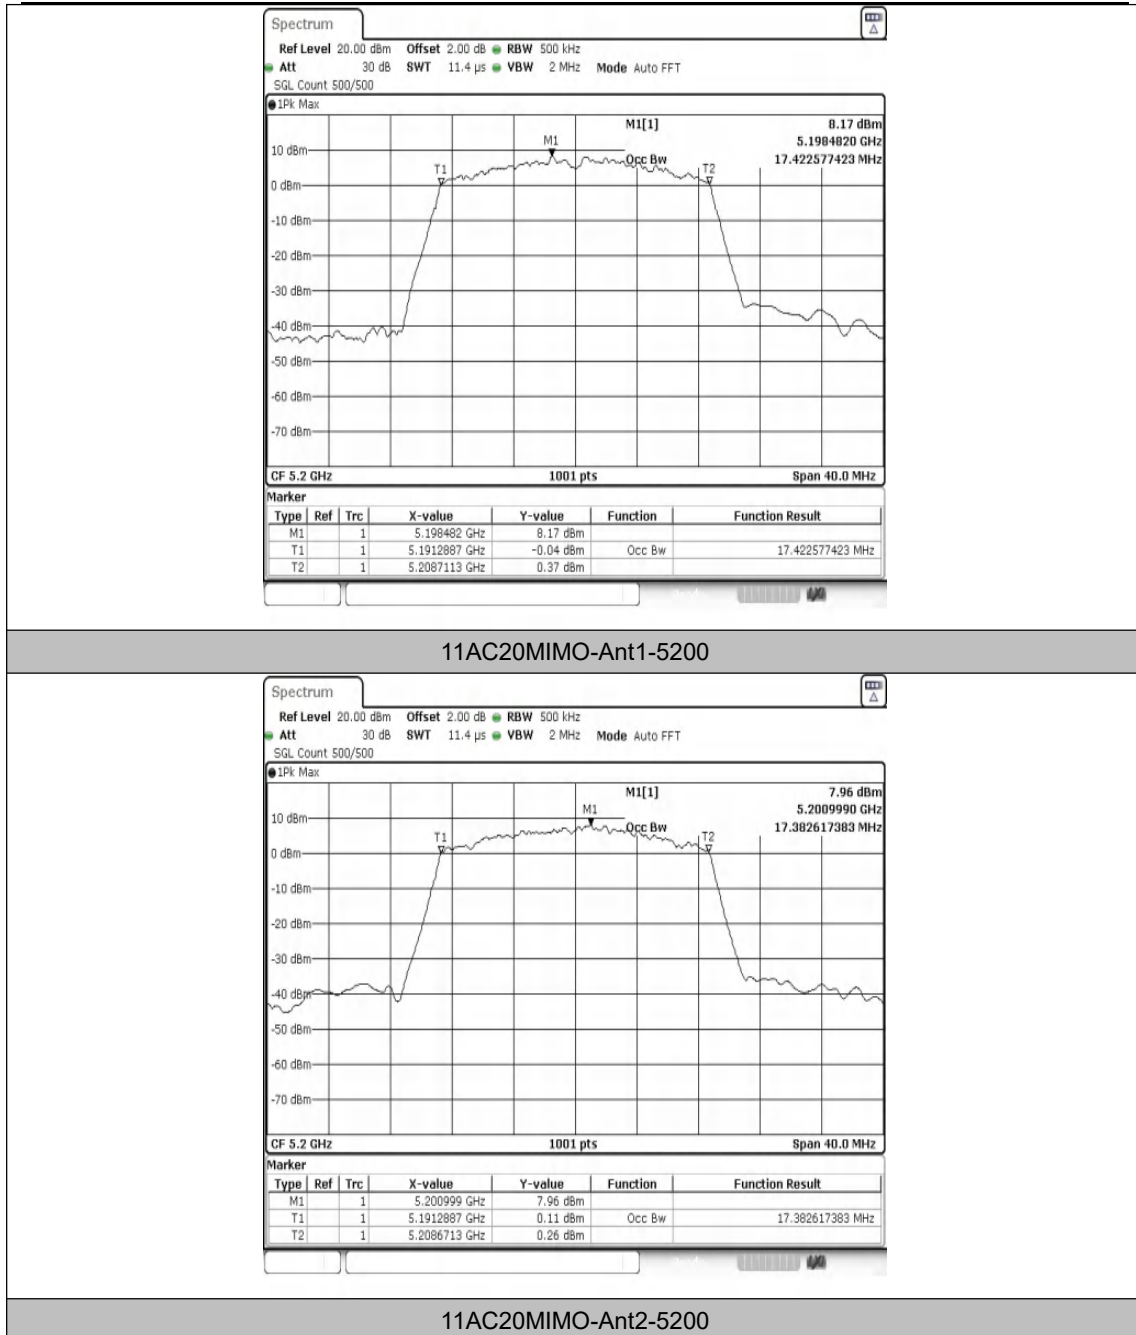


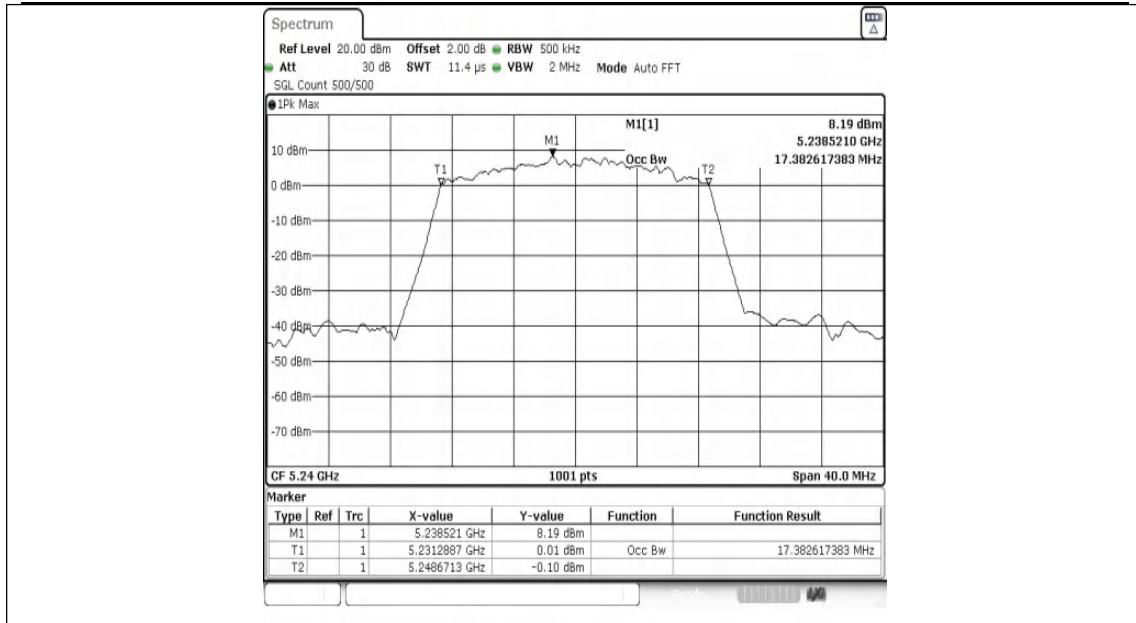


11AC20MIMO-Ant1-5240

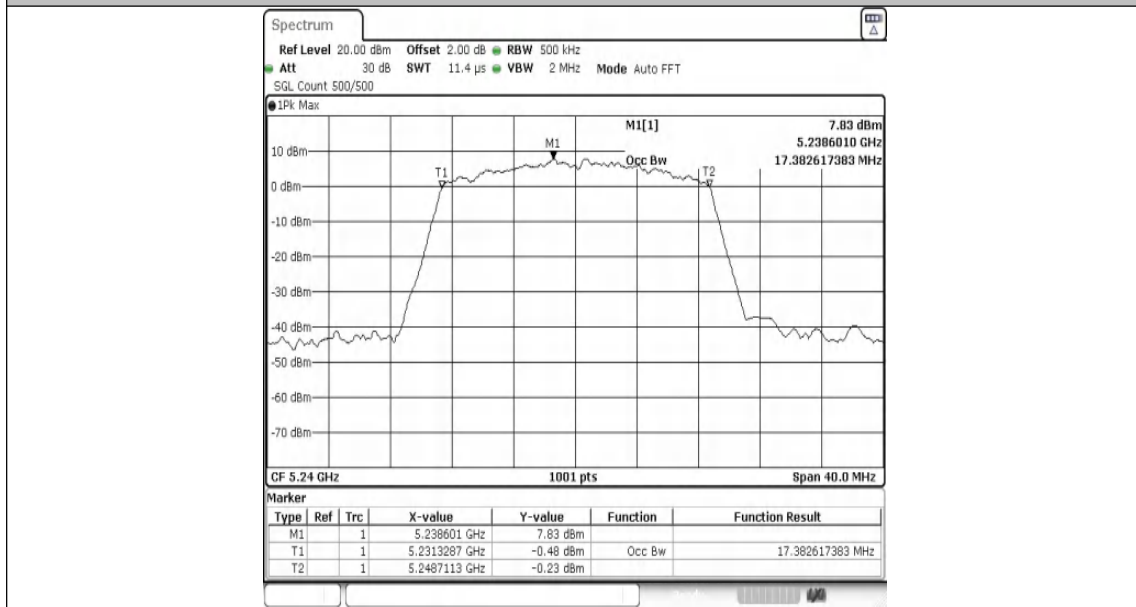


11AC20MIMO-Ant2-5240

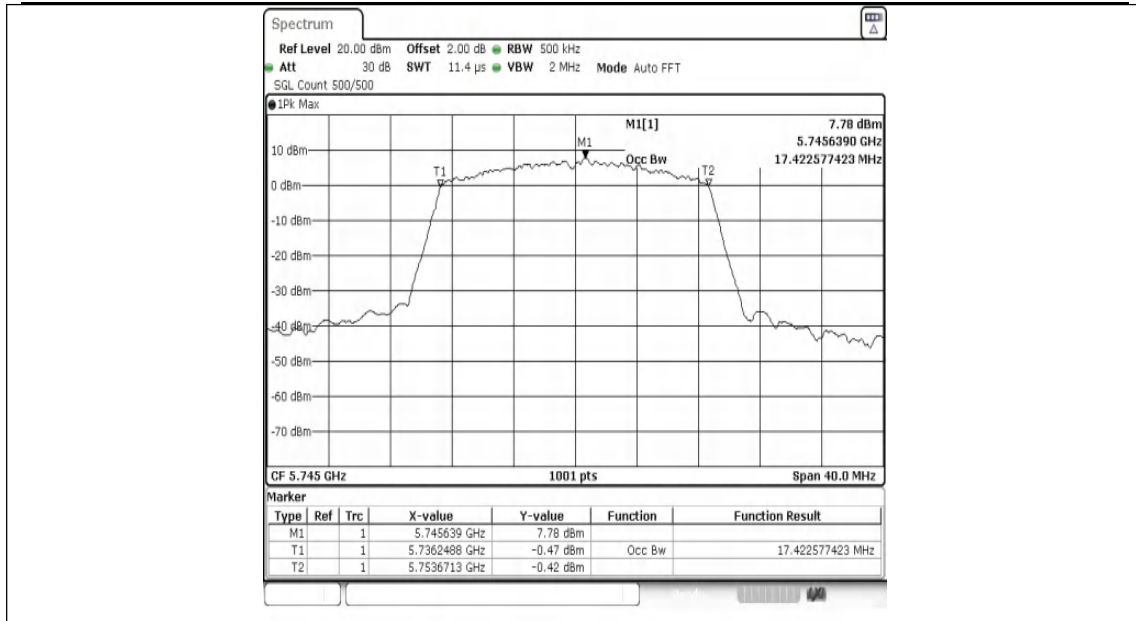


11AC20MIMO-Ant1-5745

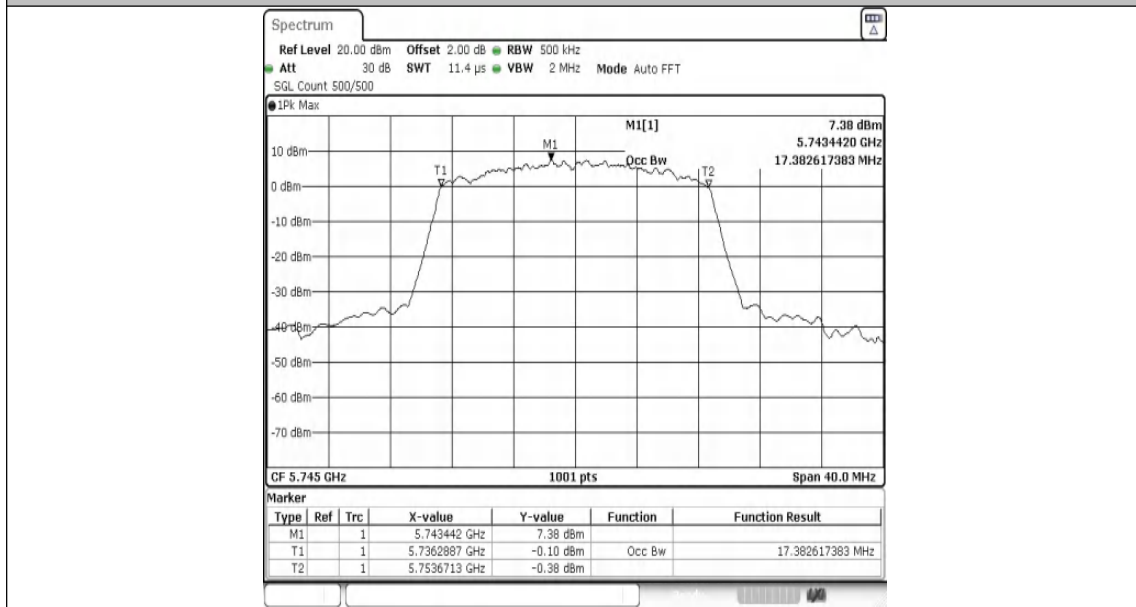


11AC20MIMO-Ant2-5745

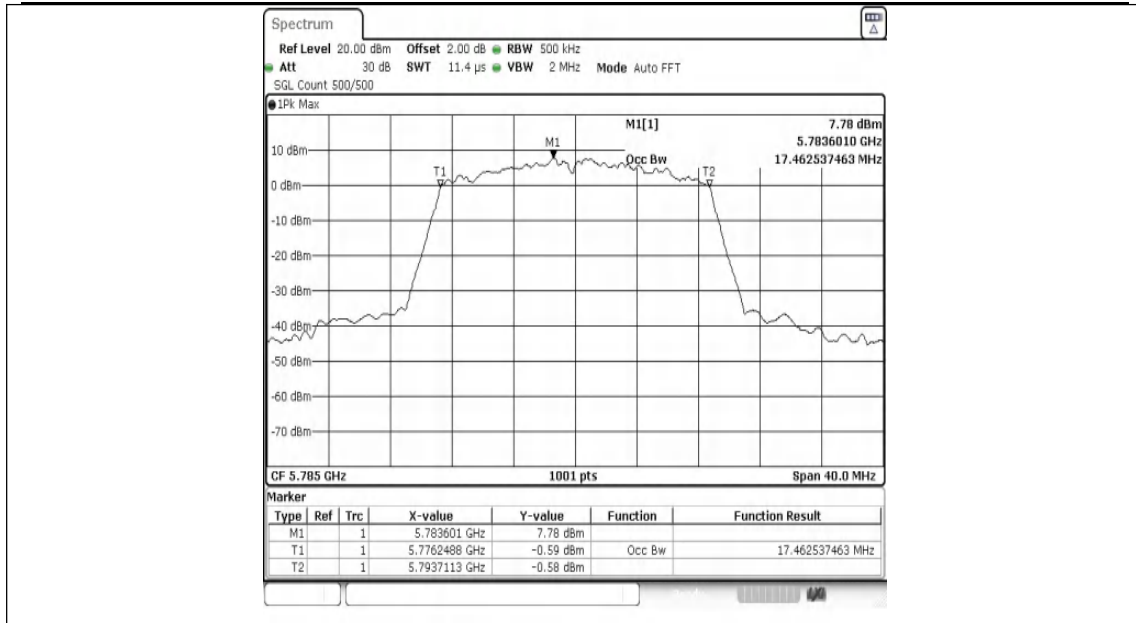


11AC20MIMO-Ant1-5785

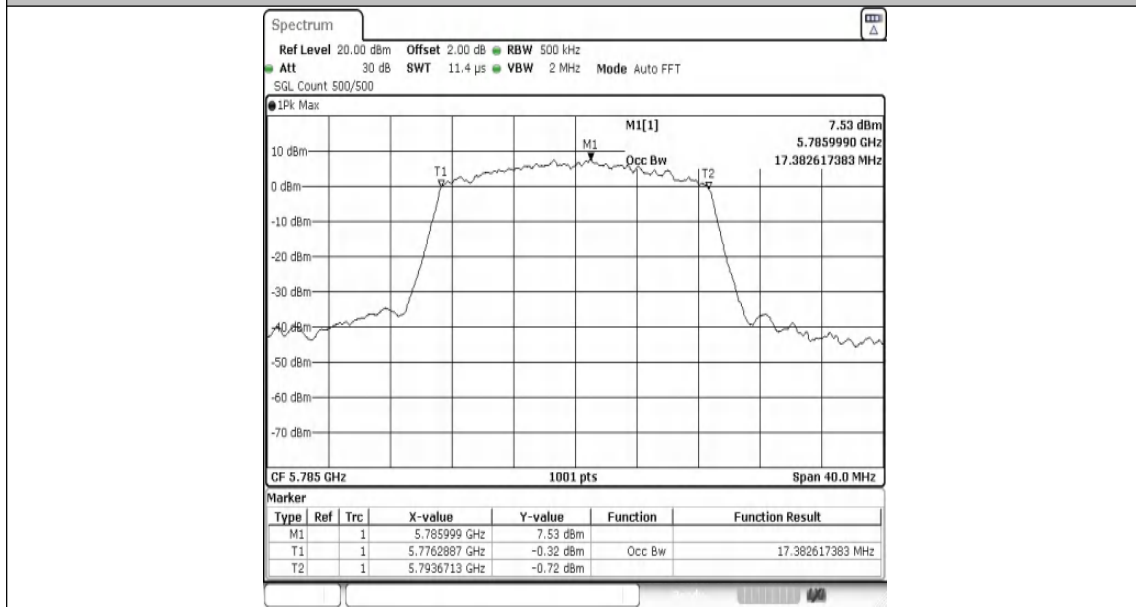


11AC20MIMO-Ant2-5785

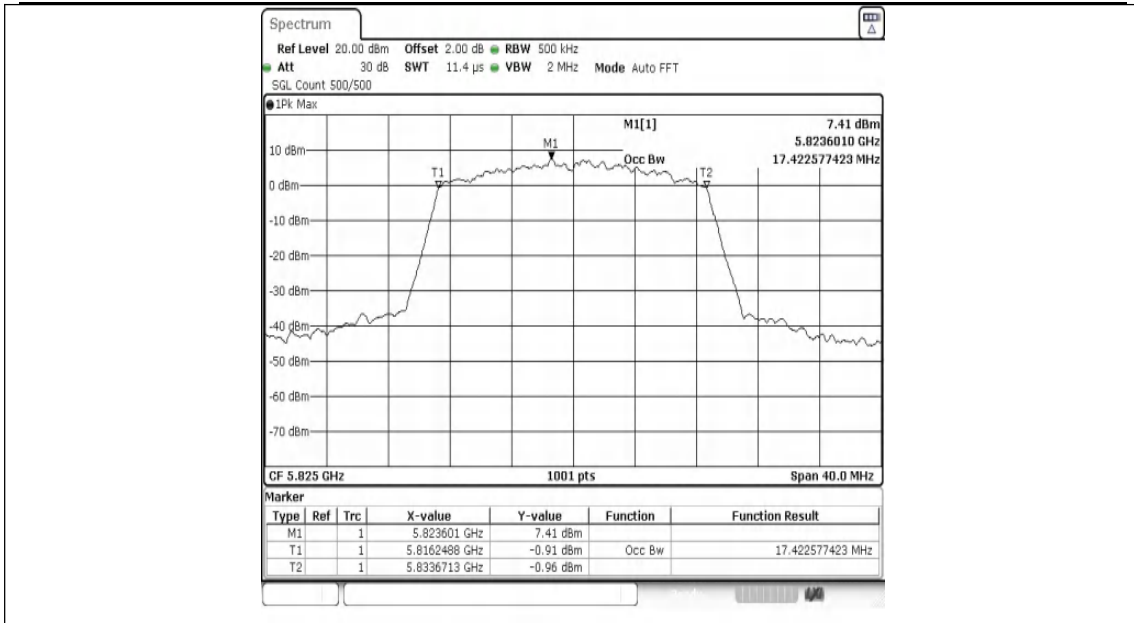


11AC20MIMO-Ant1-5825

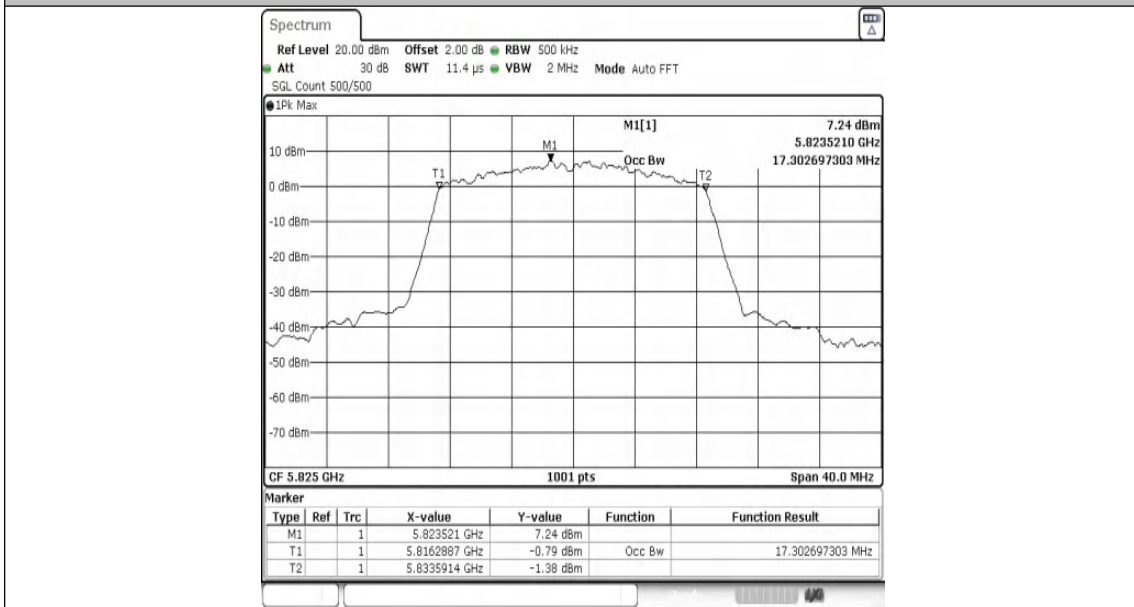


11AC20MIMO-Ant2-5825

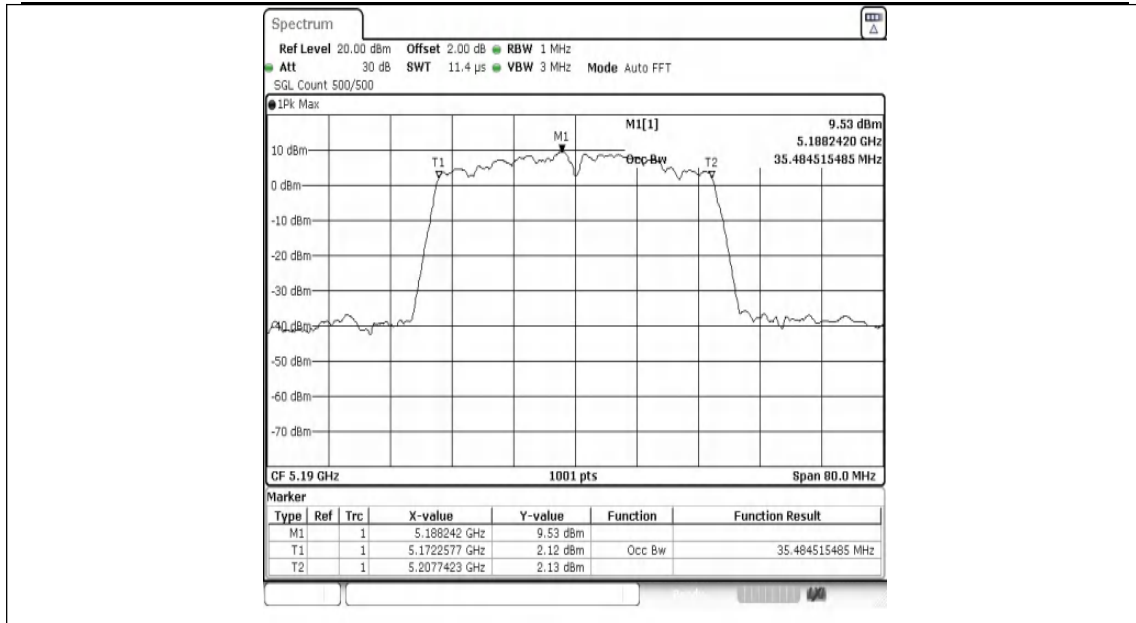


11AC40MIMO-Ant1-5190

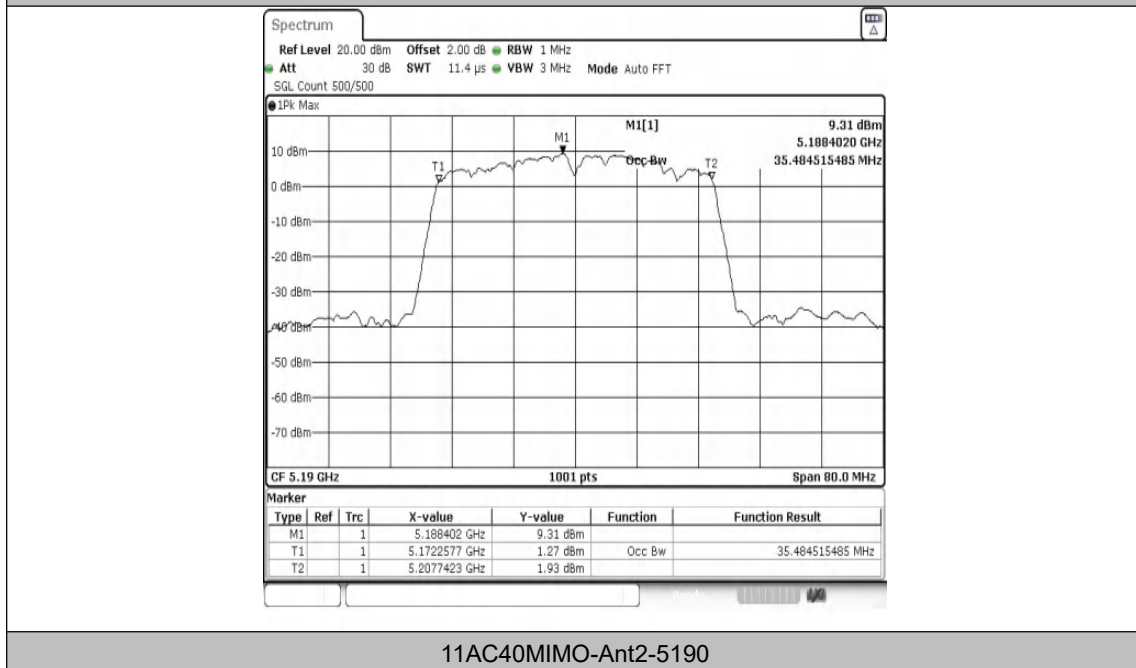


11AC40MIMO-Ant2-5190

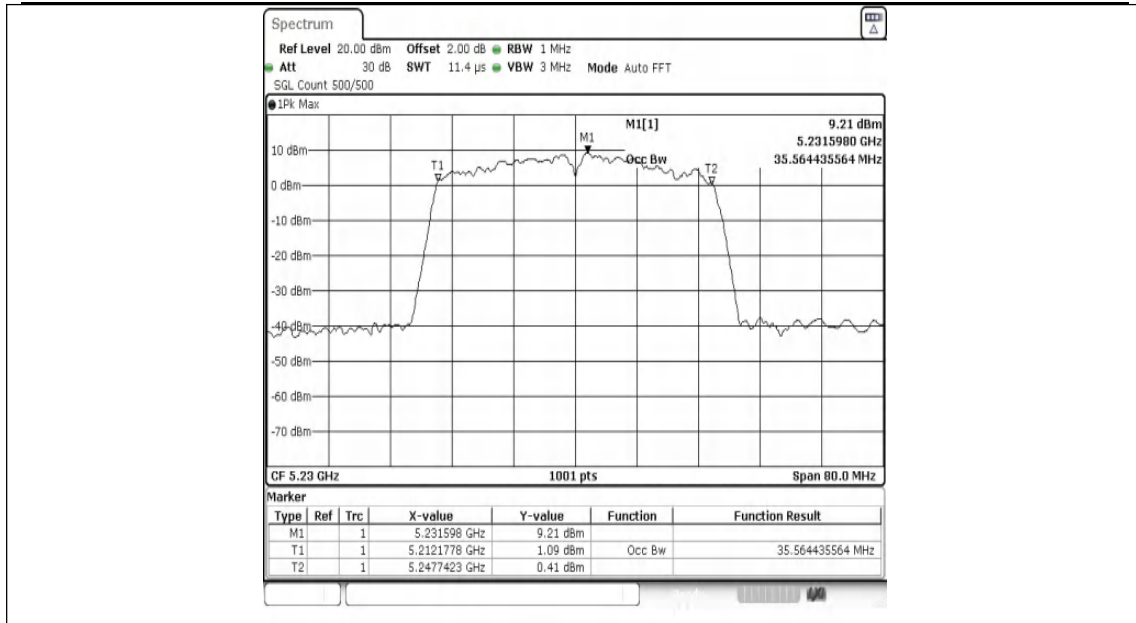


11AC40MIMO-Ant1-5230

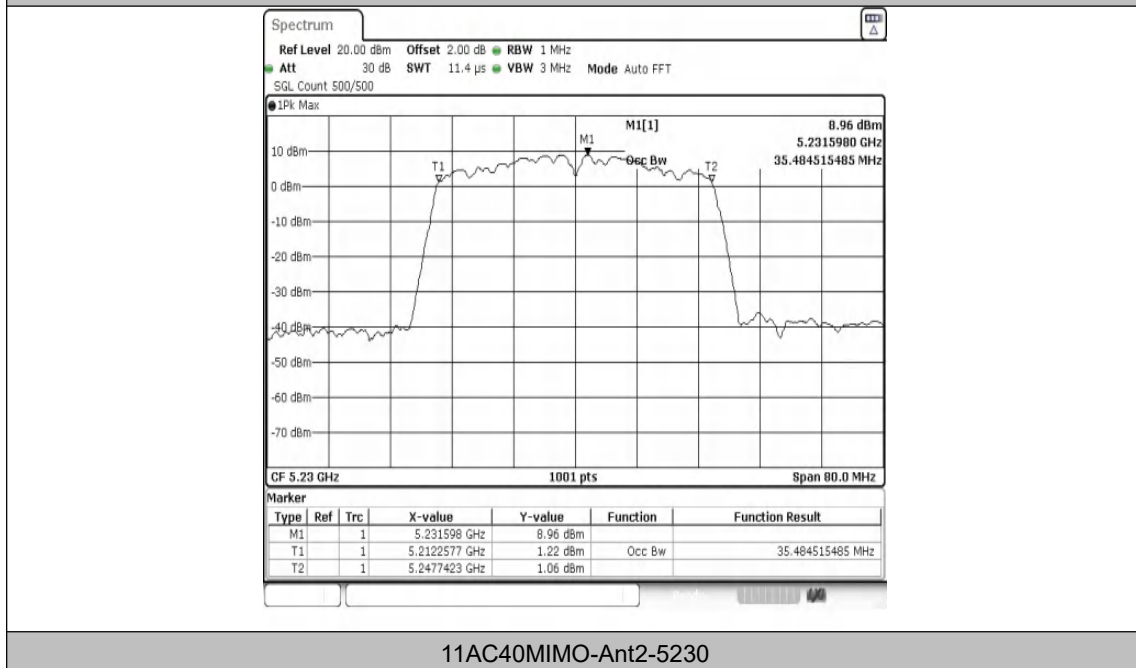


11AC40MIMO-Ant2-5230

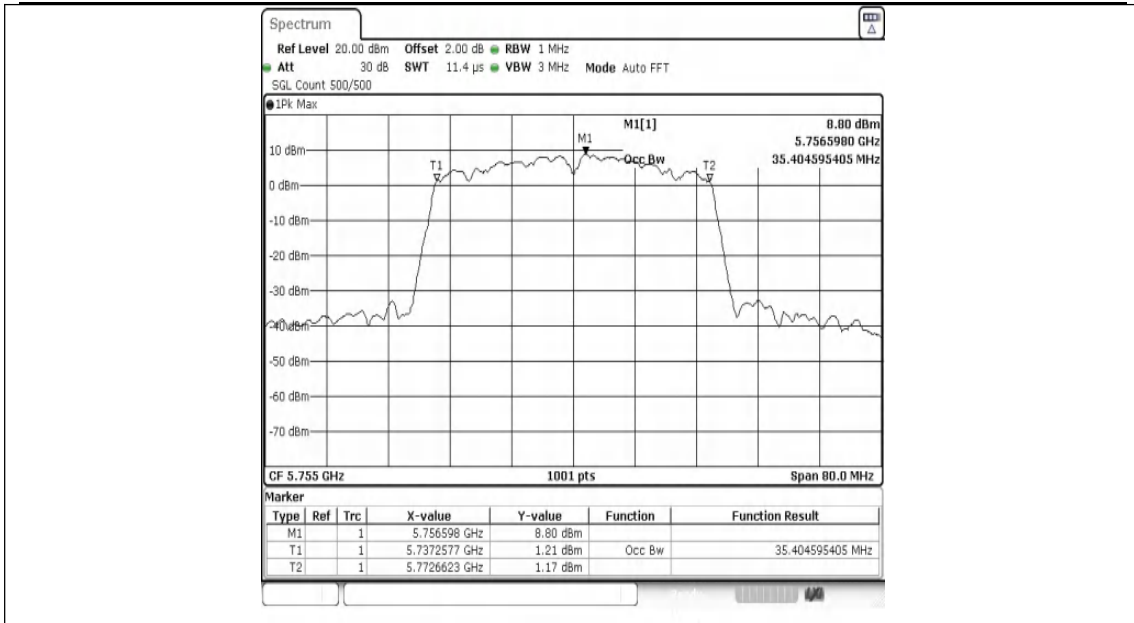


11AC40MIMO-Ant1-5755

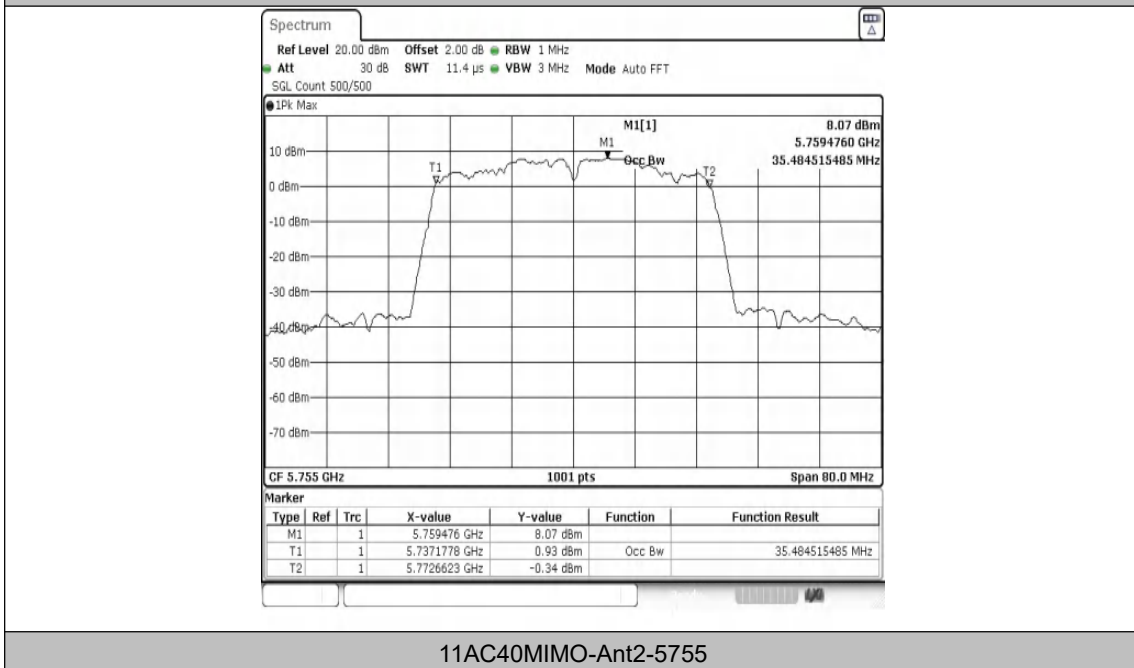


11AC40MIMO-Ant2-5755

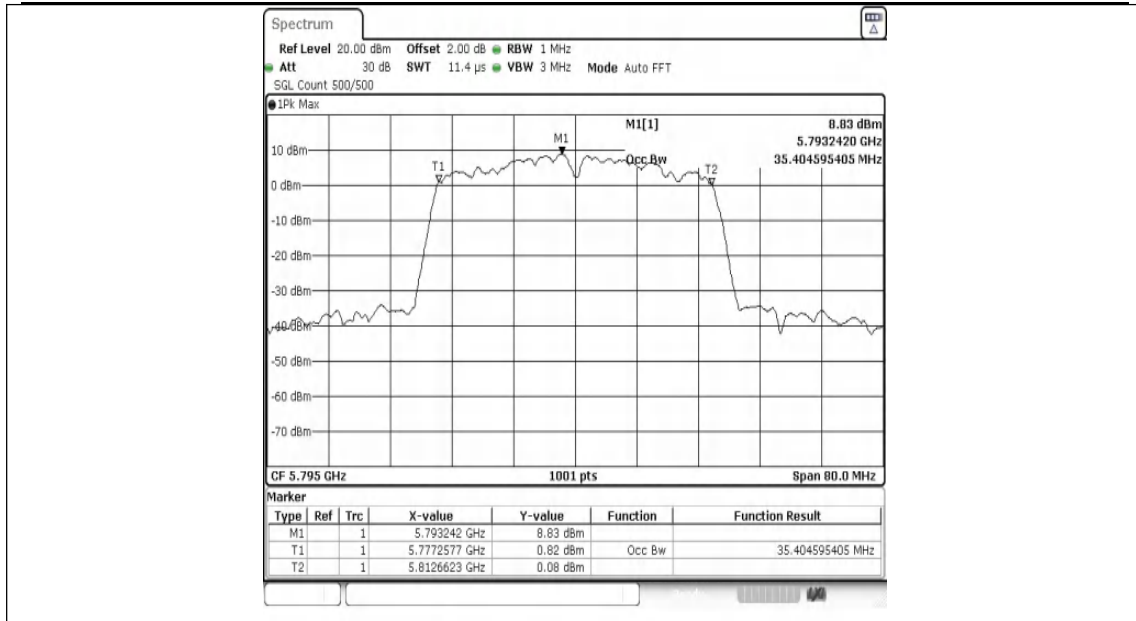


11AC40MIMO-Ant1-5795

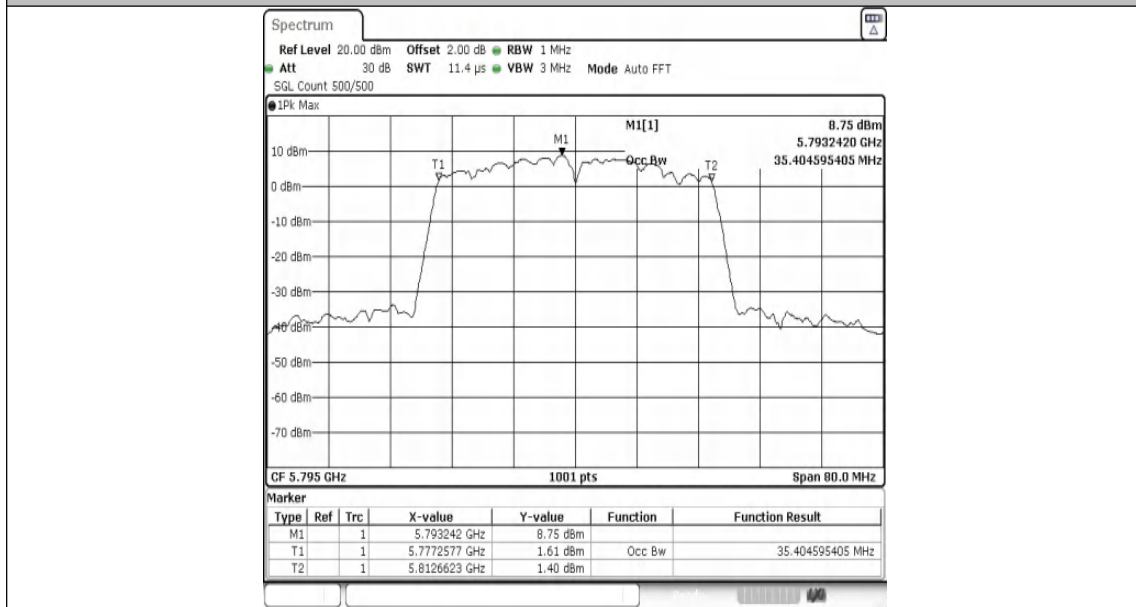

11AC40MIMO-Ant2-5795

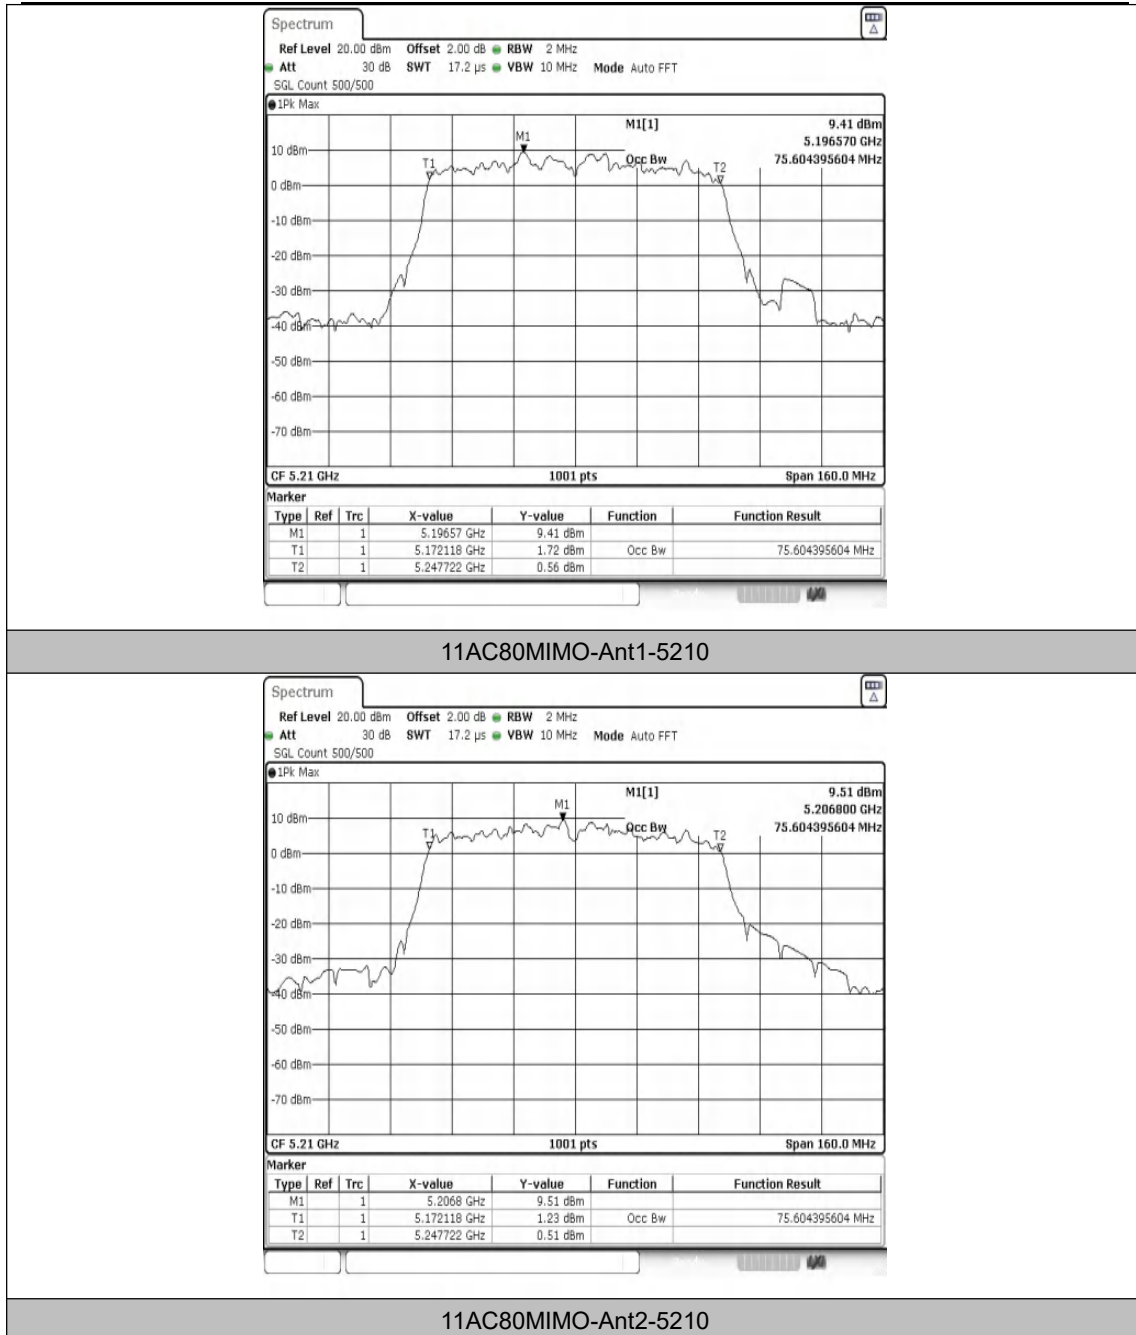

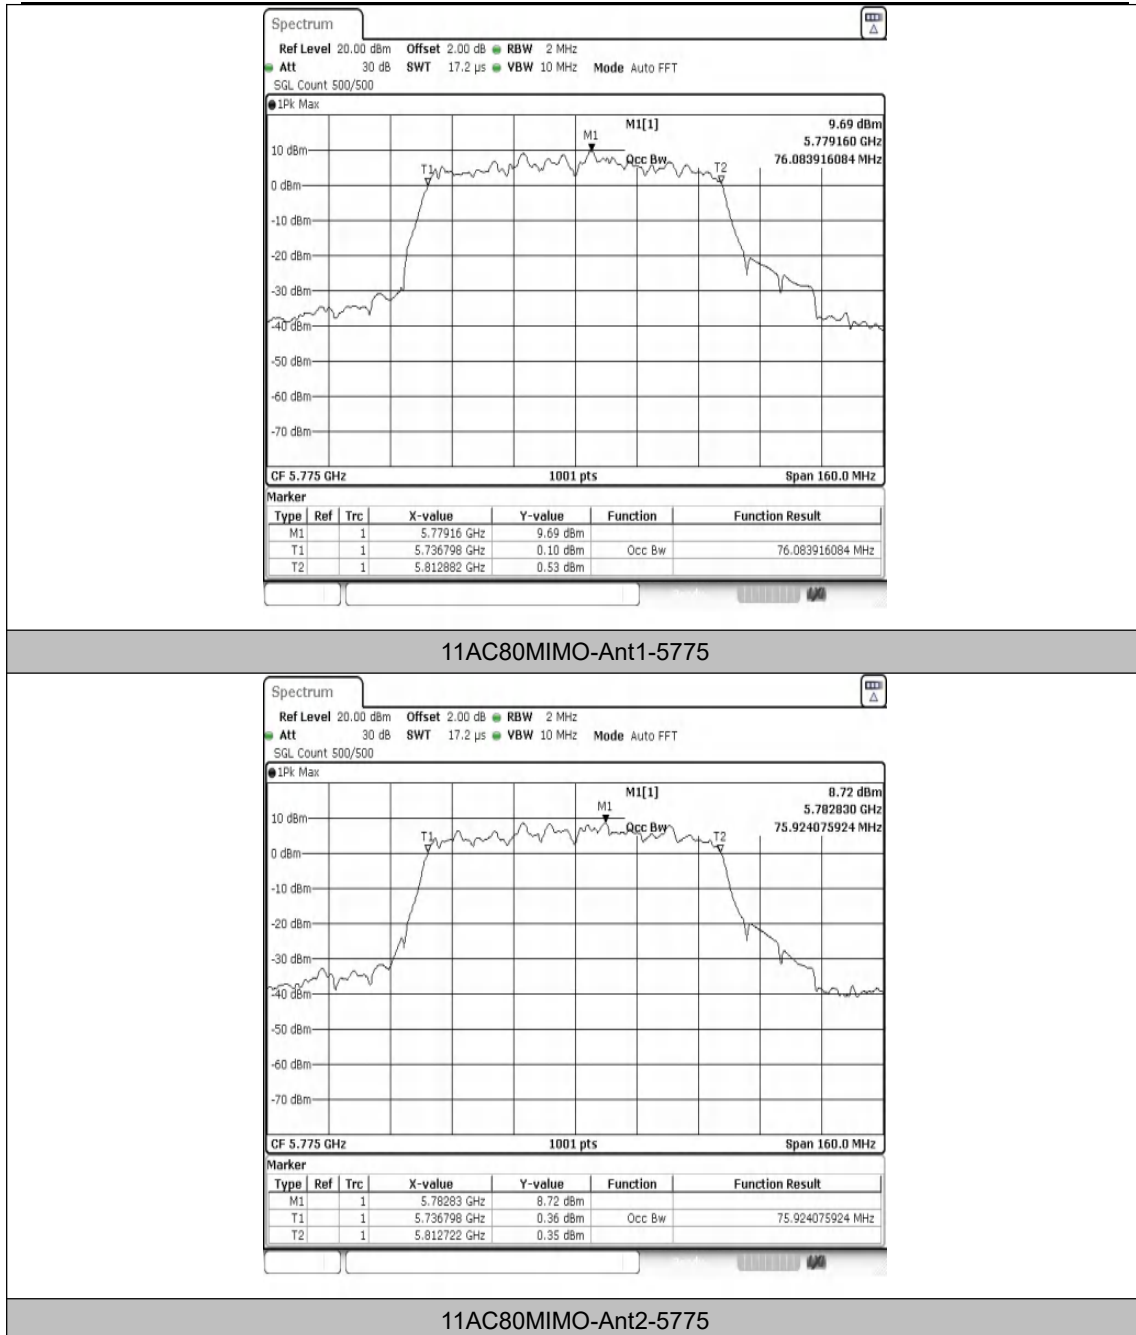


Appendix A3: Minimum 6dB Bandwidth

Test Result B4

Test Mode	Antenna	Frequency[MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	15.08	5737.44	5752.52	0.5	PASS
11A	Ant2	5745	12.60	5738.68	5751.28	0.5	PASS
11A	Ant1	5785	15.12	5777.44	5792.56	0.5	PASS
11A	Ant2	5785	15.68	5777.20	5792.88	0.5	PASS
11A	Ant1	5825	15.08	5817.48	5832.56	0.5	PASS
11A	Ant2	5825	13.84	5818.68	5832.52	0.5	PASS
11N20MIMO	Ant1	5745	15.04	5737.48	5752.52	0.5	PASS
11N20MIMO	Ant2	5745	15.08	5737.44	5752.52	0.5	PASS
11N20MIMO	Ant1	5785	15.08	5777.44	5792.52	0.5	PASS
11N20MIMO	Ant2	5785	15.08	5777.44	5792.52	0.5	PASS
11N20MIMO	Ant1	5825	15.08	5817.44	5832.52	0.5	PASS
11N20MIMO	Ant2	5825	15.08	5817.44	5832.52	0.5	PASS
11N40MIMO	Ant1	5755	33.84	5738.68	5772.52	0.5	PASS
11N40MIMO	Ant2	5755	33.84	5738.68	5772.52	0.5	PASS
11N40MIMO	Ant1	5795	31.36	5778.68	5810.04	0.5	PASS
11N40MIMO	Ant2	5795	33.84	5778.68	5812.52	0.5	PASS
11AC20MIMO	Ant1	5745	15.04	5737.48	5752.52	0.5	PASS
11AC20MIMO	Ant2	5745	15.04	5737.48	5752.52	0.5	PASS
11AC20MIMO	Ant1	5785	13.84	5778.68	5792.52	0.5	PASS
11AC20MIMO	Ant2	5785	13.84	5778.68	5792.52	0.5	PASS
11AC20MIMO	Ant1	5825	15.08	5817.44	5832.52	0.5	PASS
11AC20MIMO	Ant2	5825	13.84	5818.68	5832.52	0.5	PASS
11AC40MIMO	Ant1	5755	28.88	5738.68	5767.56	0.5	PASS
11AC40MIMO	Ant2	5755	30.08	5738.68	5768.76	0.5	PASS
11AC40MIMO	Ant1	5795	31.36	5778.68	5810.04	0.5	PASS
11AC40MIMO	Ant2	5795	35.04	5777.48	5812.52	0.5	PASS
11AC80MIMO	Ant1	5775	75.20	5737.40	5812.60	0.5	PASS
11AC80MIMO	Ant2	5775	75.20	5737.40	5812.60	0.5	PASS


Test Graphs B4

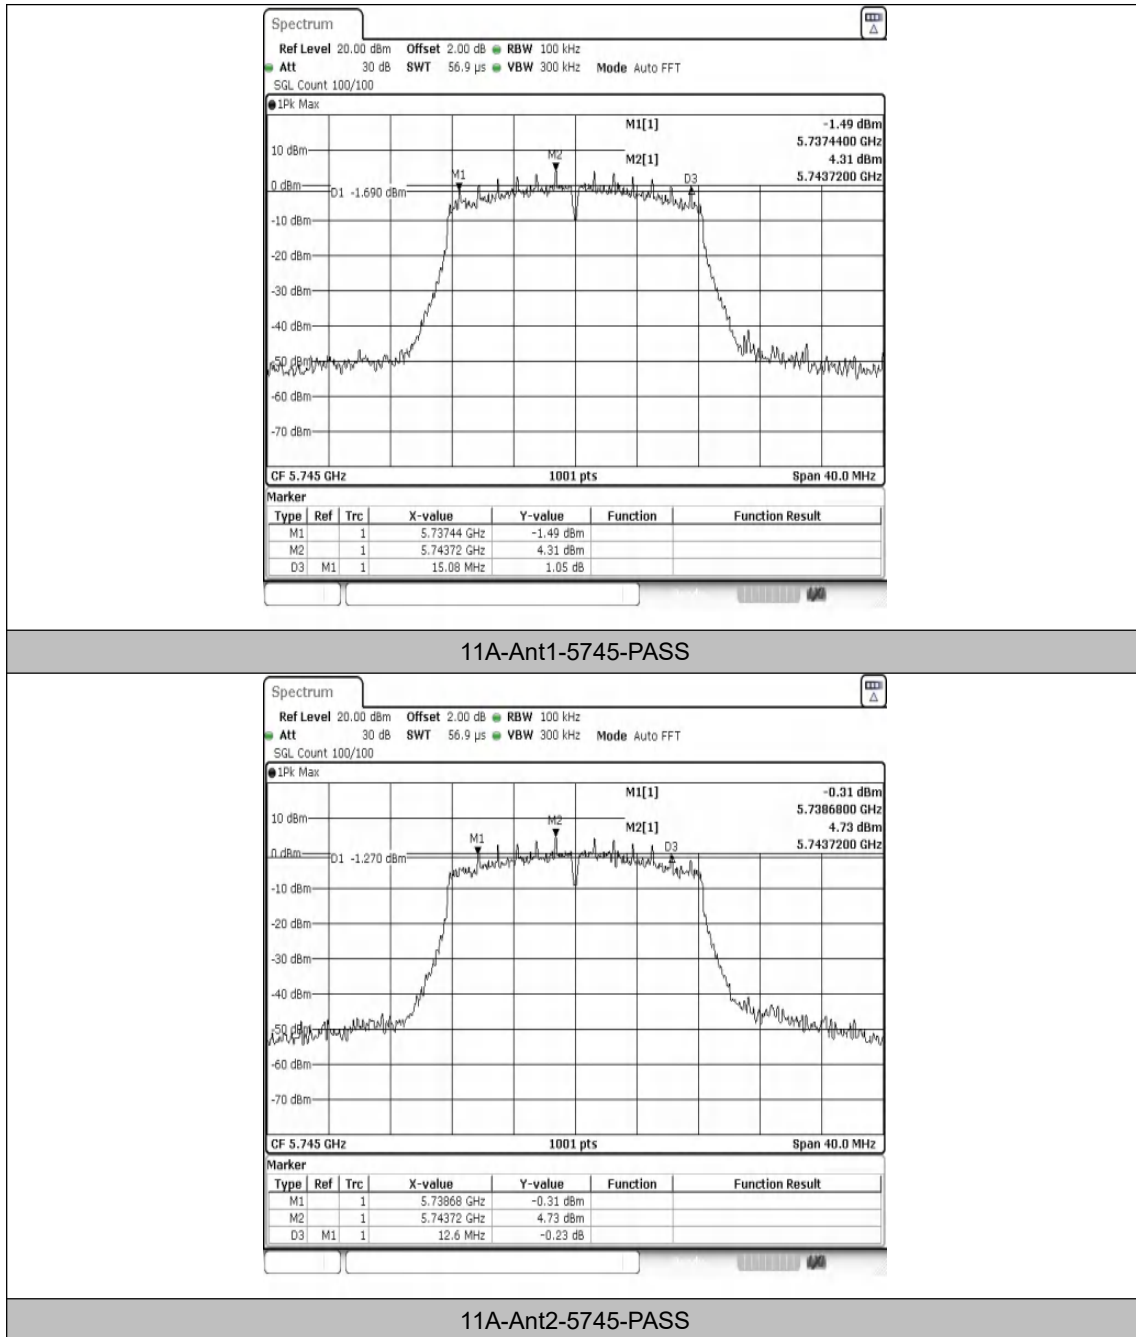


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

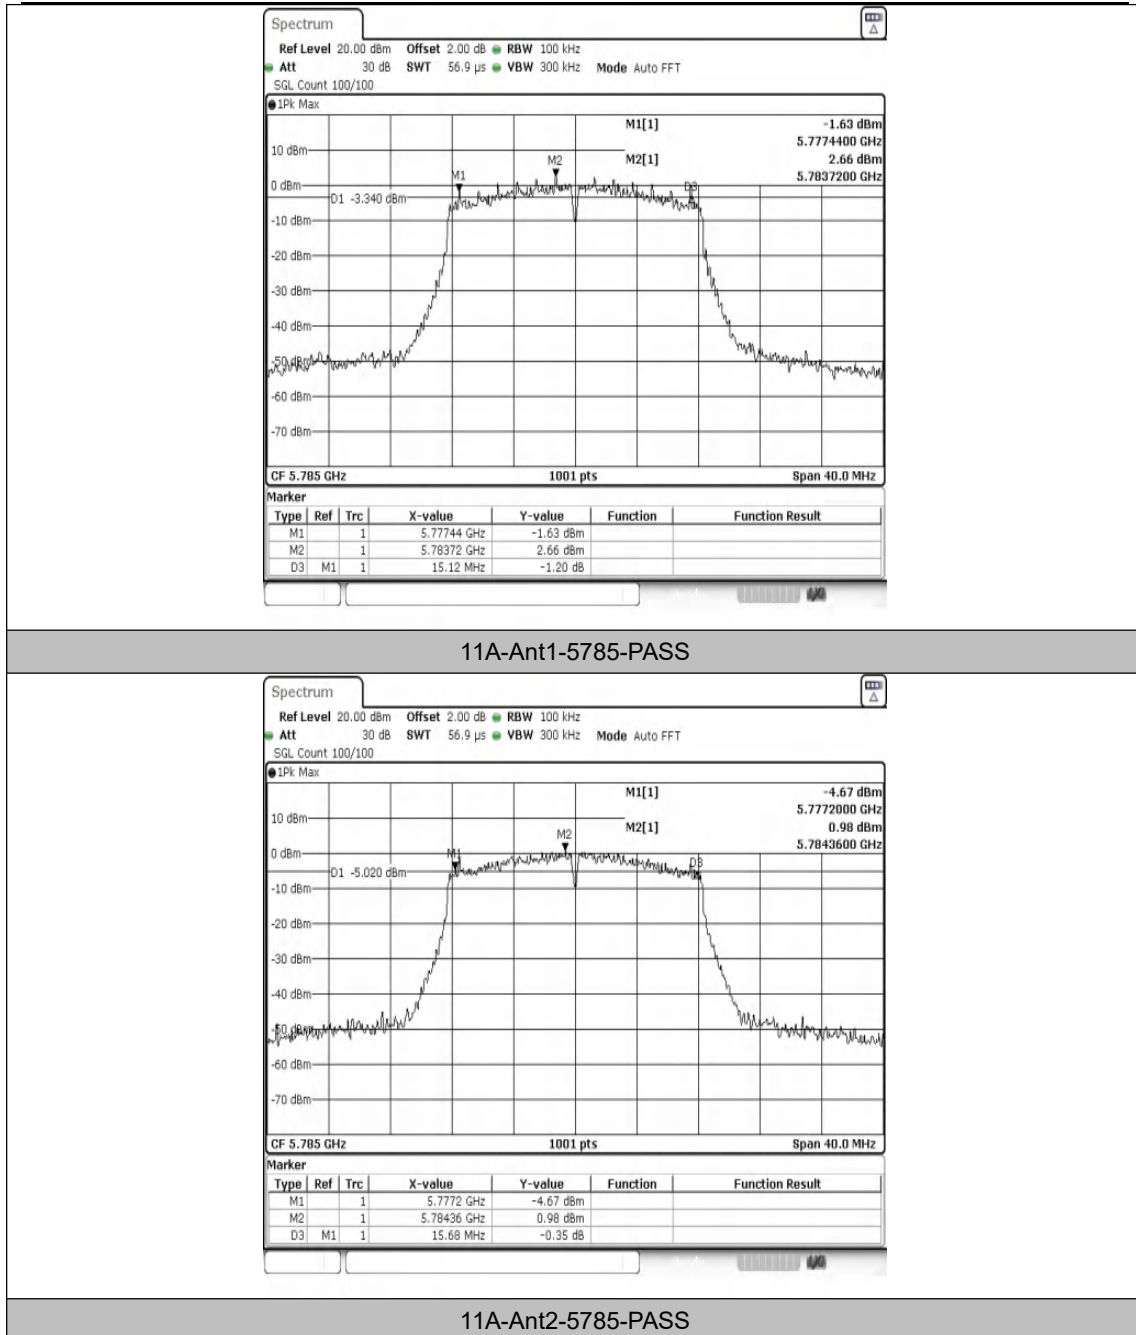


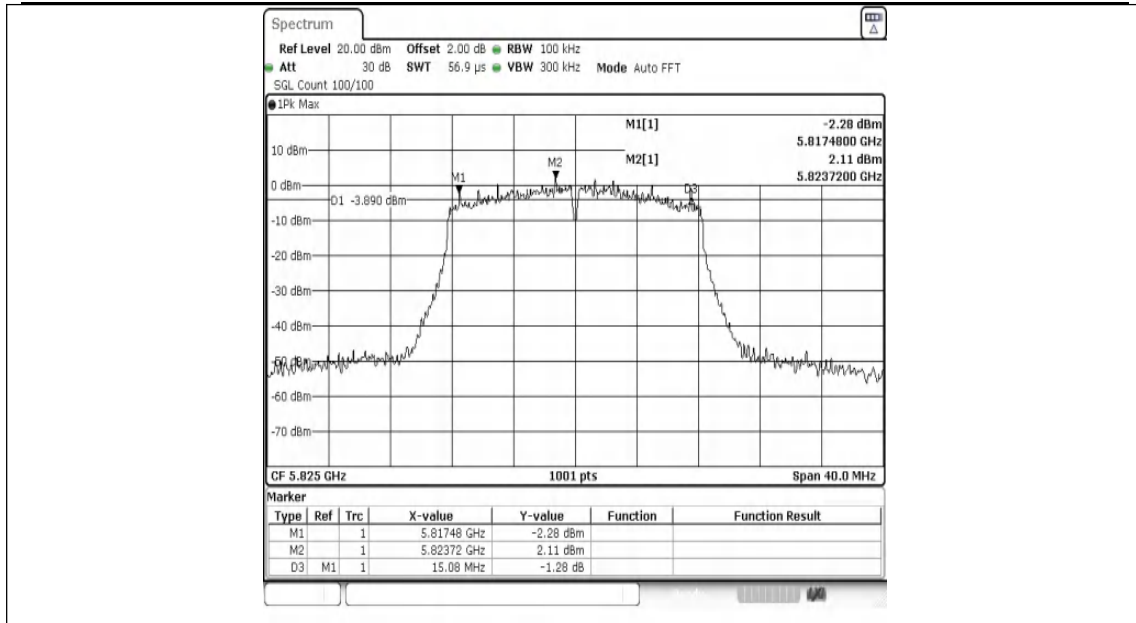


11A-Ant1-5825-PASS

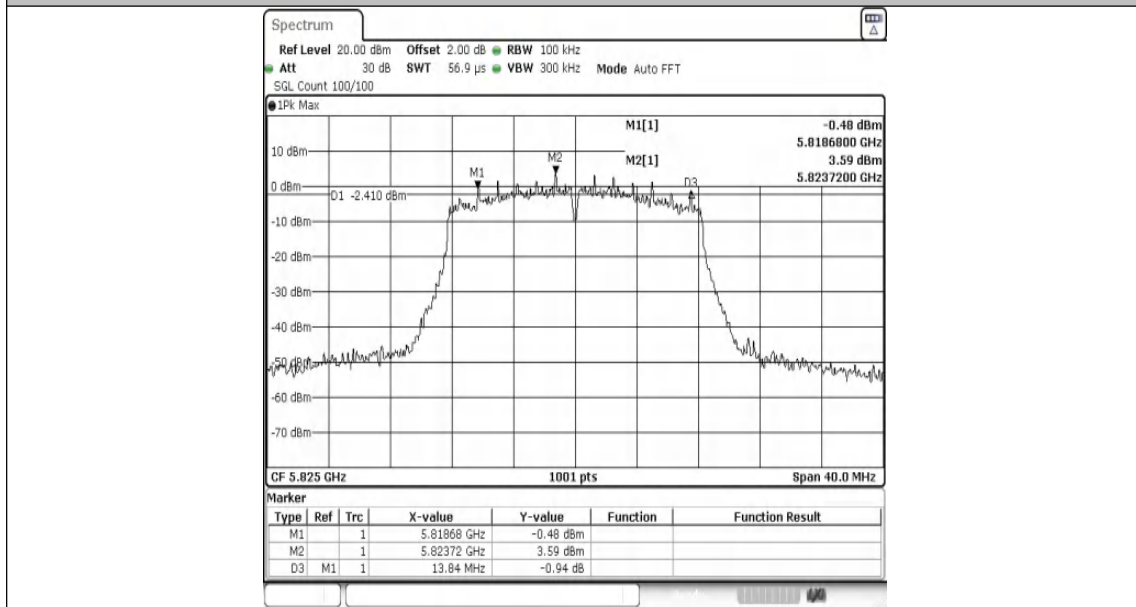


11A-Ant2-5825-PASS

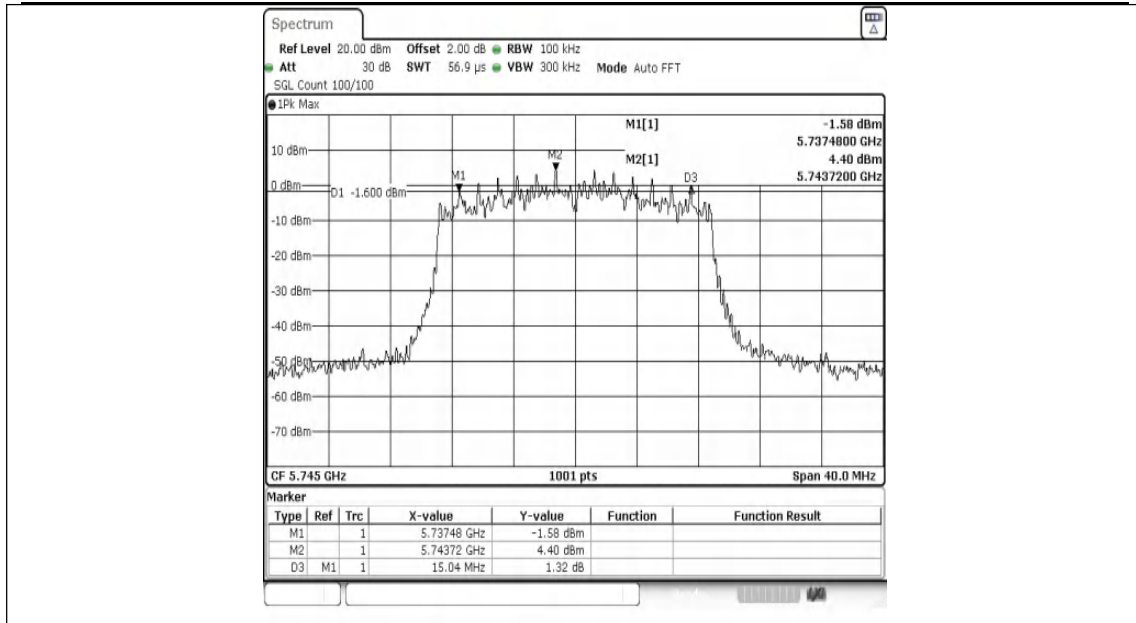


11N20MIMO-Ant1-5745-PASS

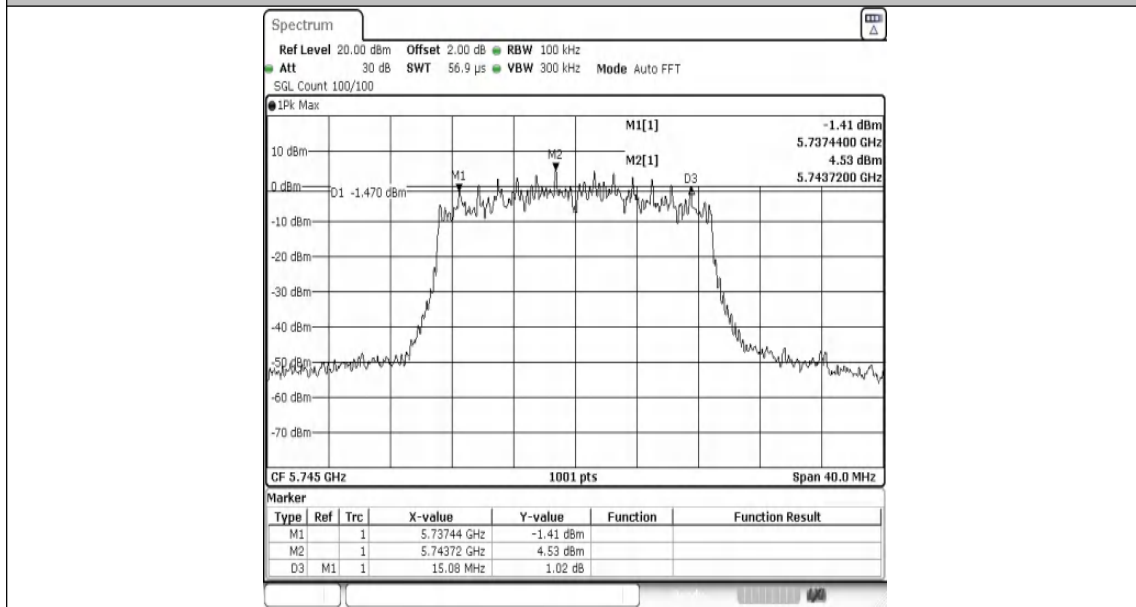


11N20MIMO-Ant2-5745-PASS

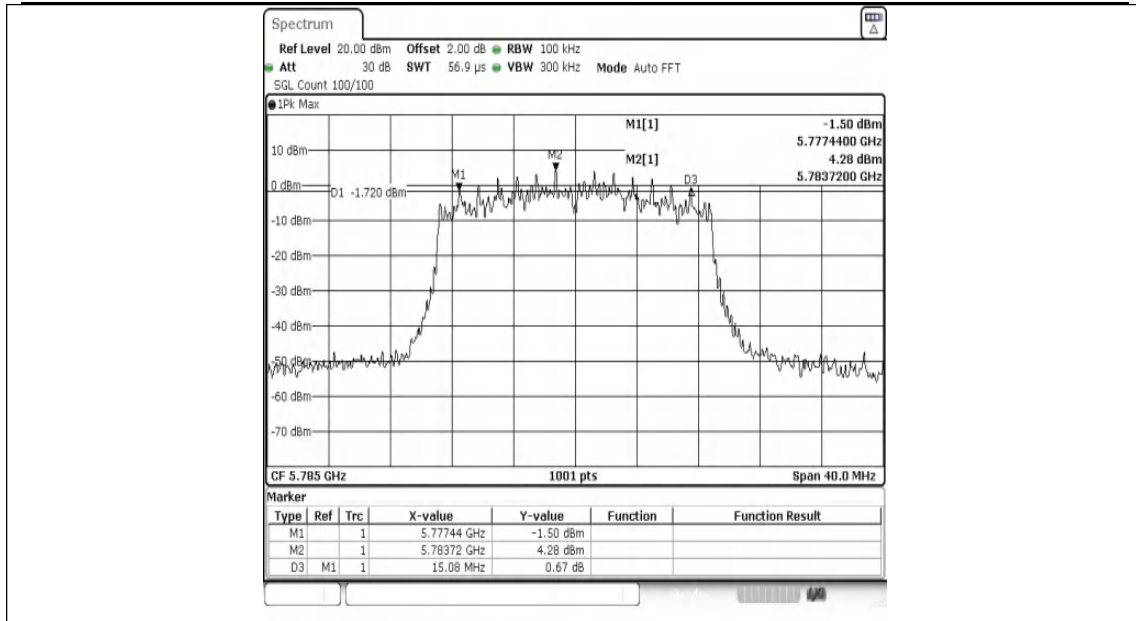


11N20MIMO-Ant1-5785-PASS

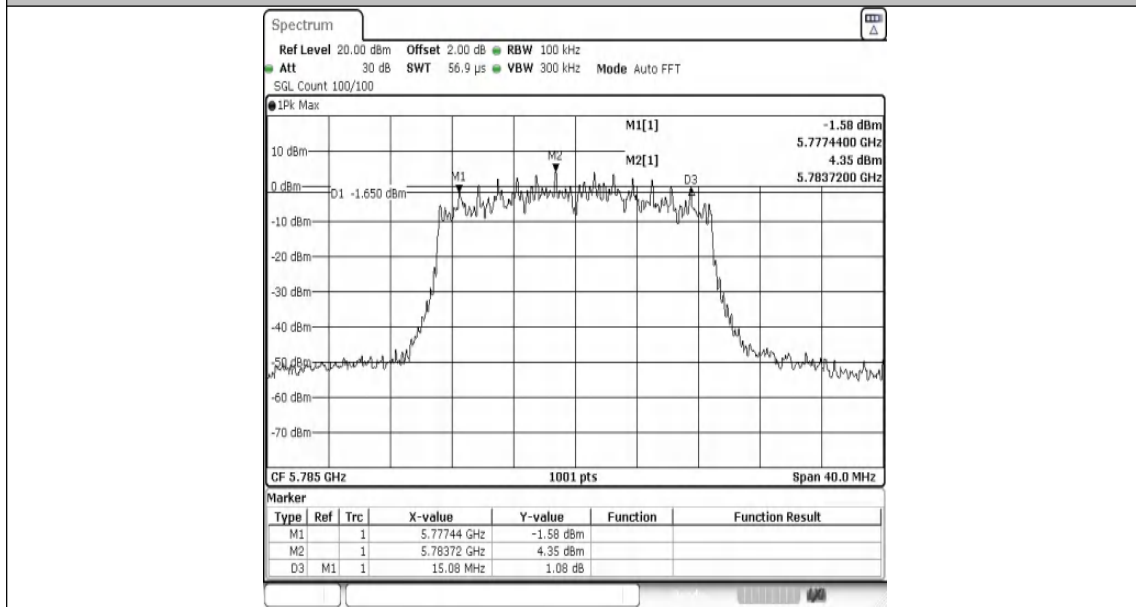


11N20MIMO-Ant2-5785-PASS

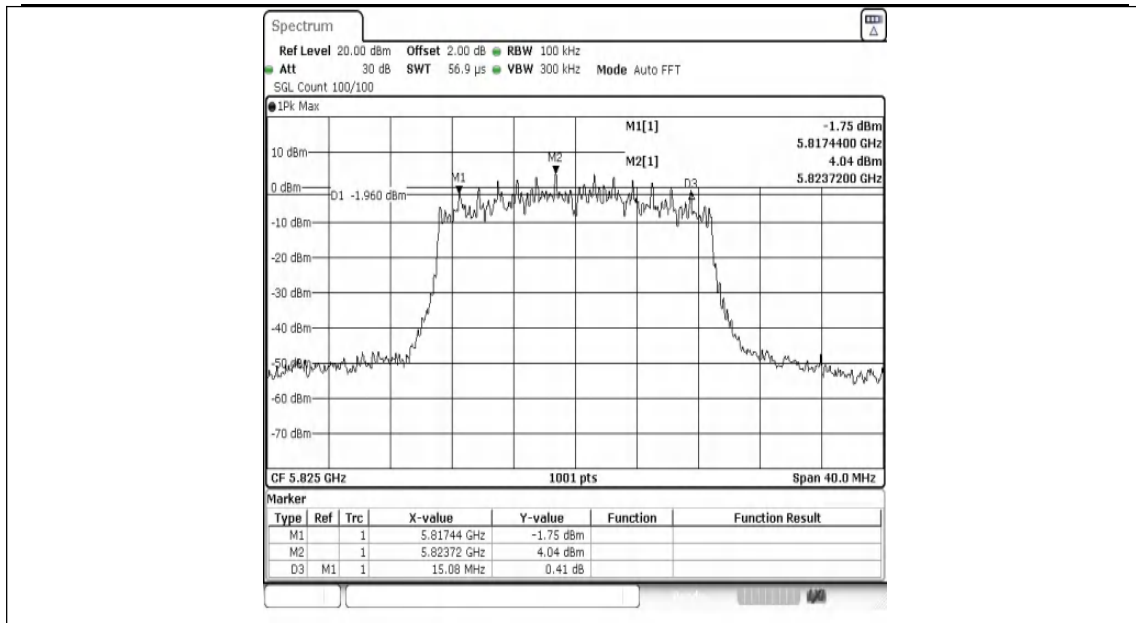


11N20MIMO-Ant1-5825-PASS

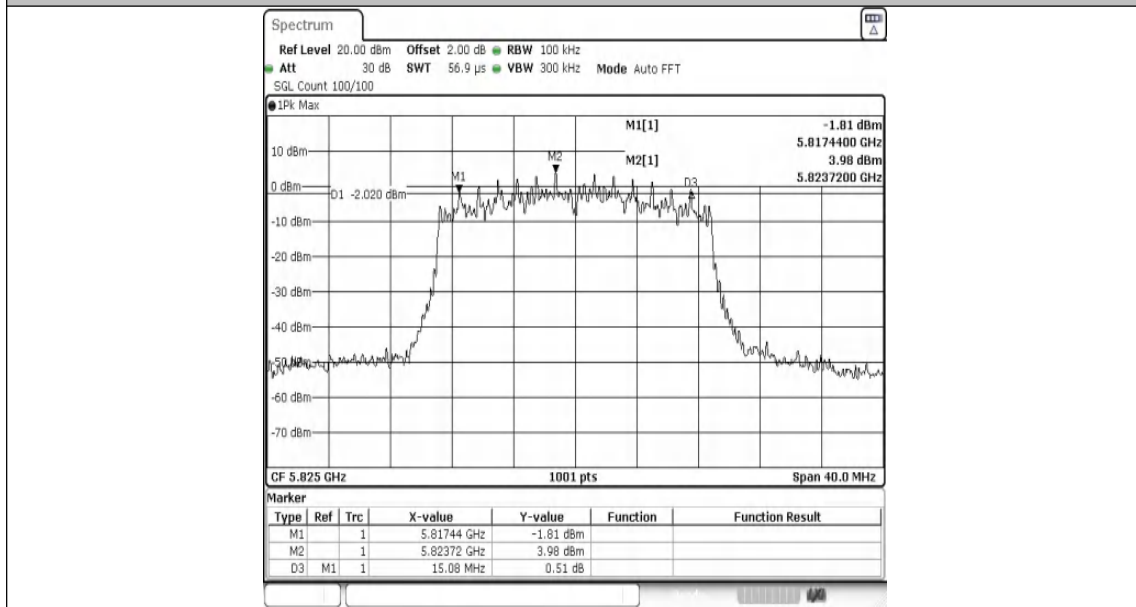


11N20MIMO-Ant2-5825-PASS

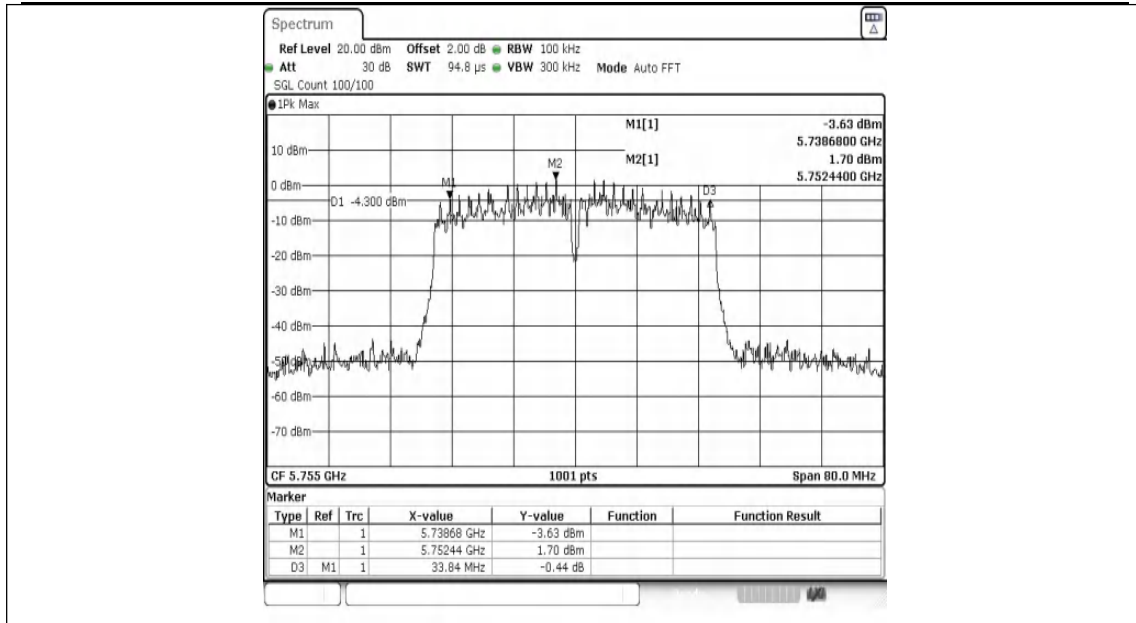


11N40MIMO-Ant1-5755-PASS

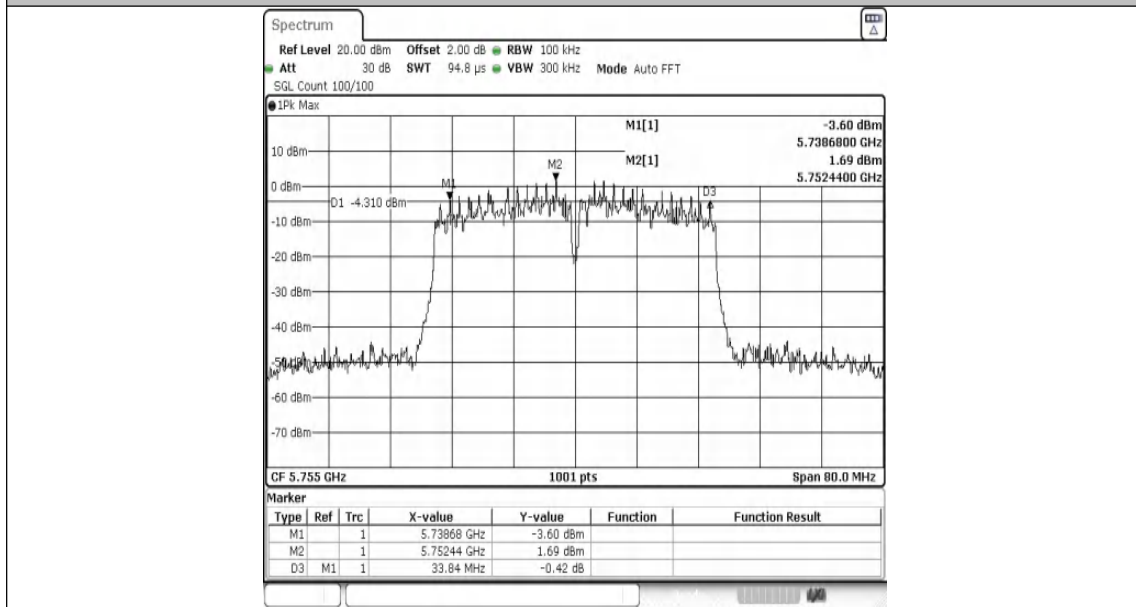


11N40MIMO-Ant2-5755-PASS

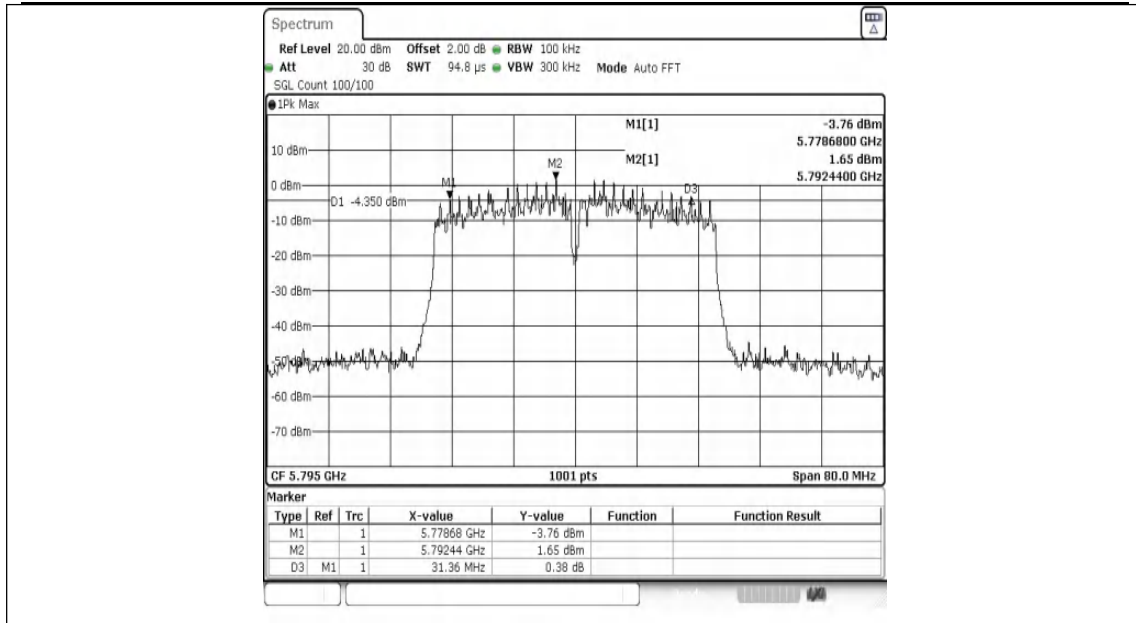


11N40MIMO-Ant1-5795-PASS

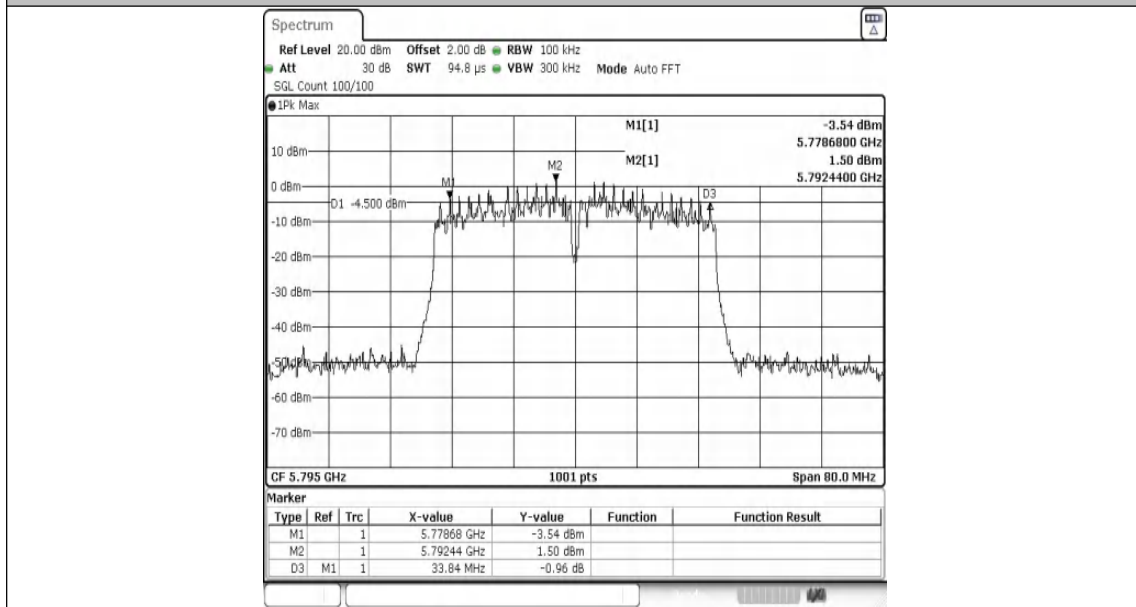


11N40MIMO-Ant2-5795-PASS

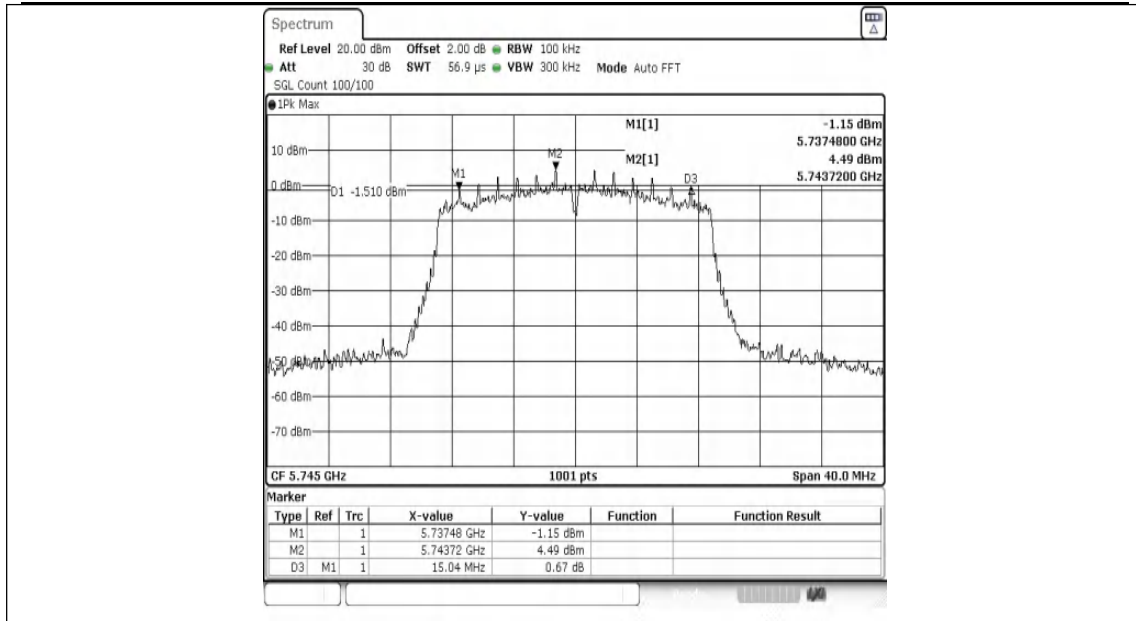


11AC20MIMO-Ant1-5745-PASS

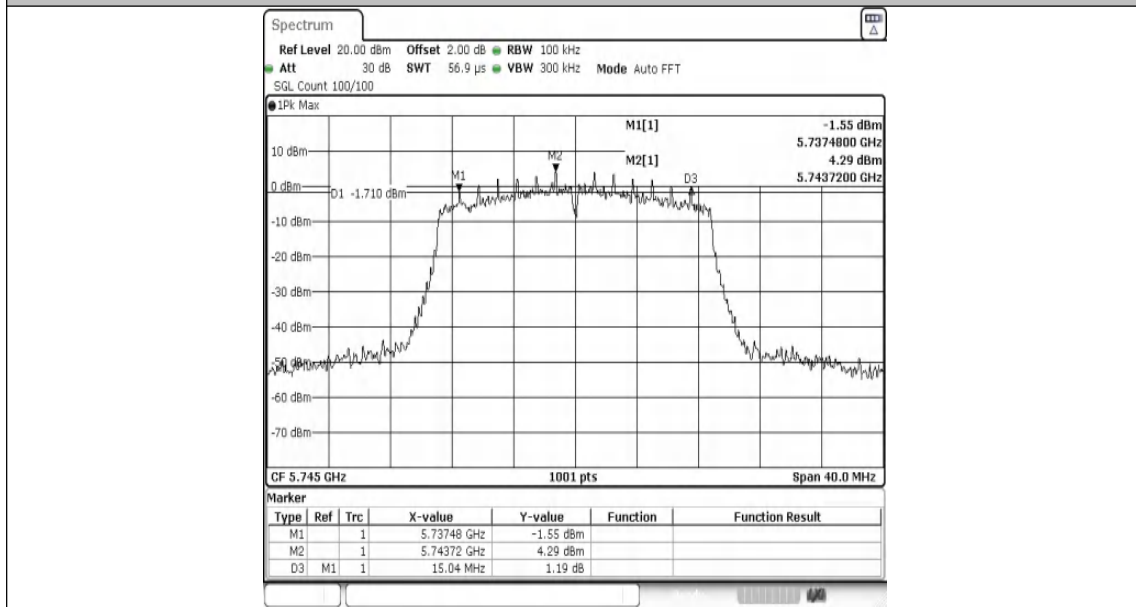


11AC20MIMO-Ant2-5745-PASS

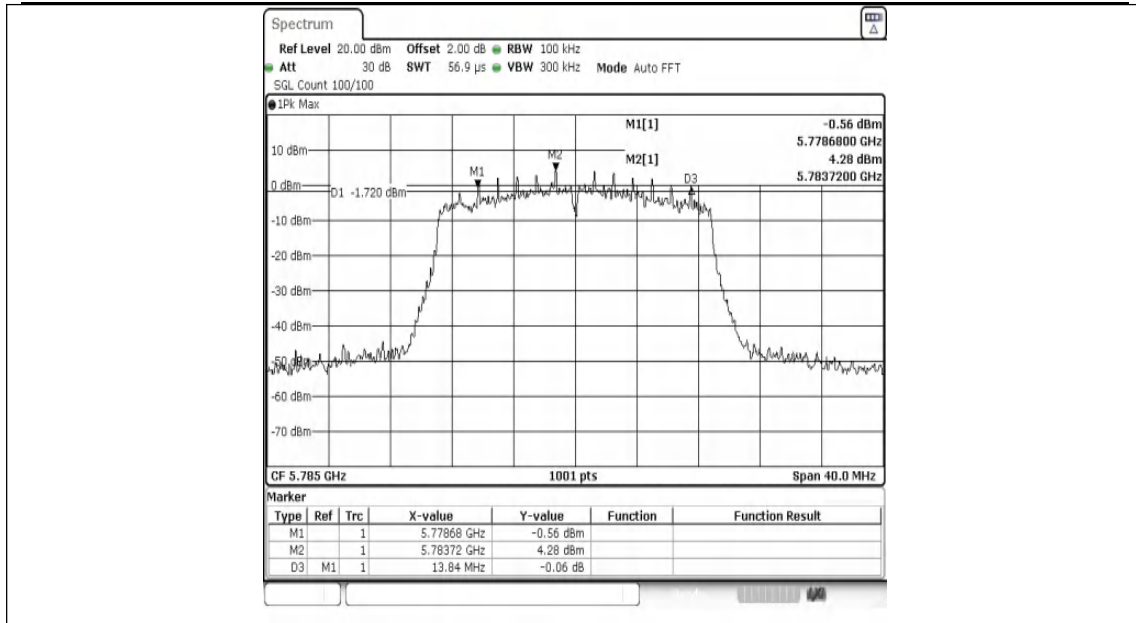


11AC20MIMO-Ant1-5785-PASS

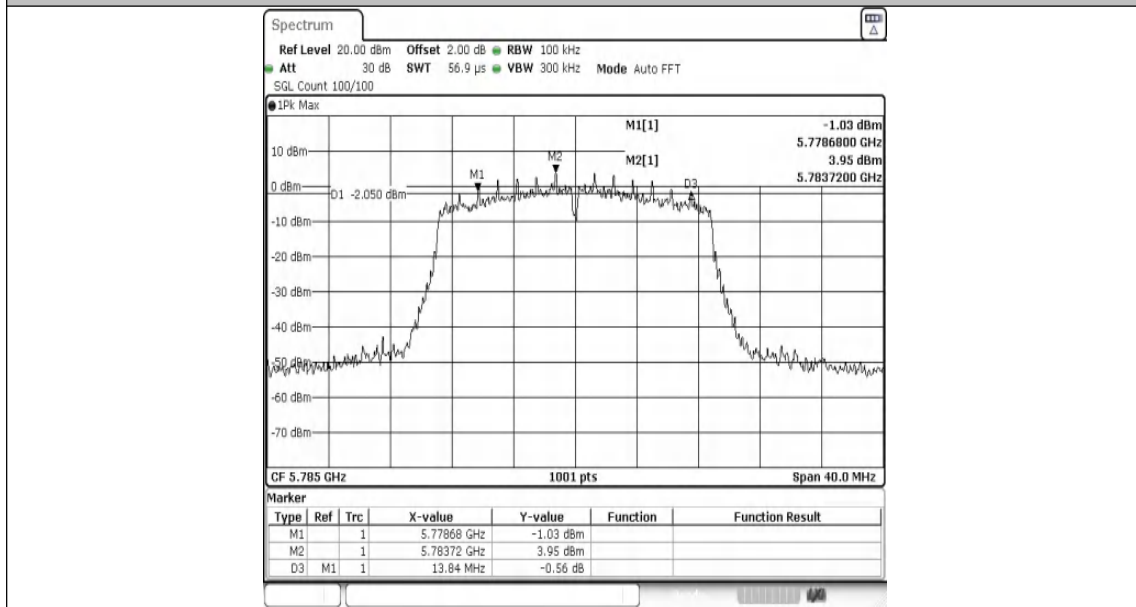


11AC20MIMO-Ant2-5785-PASS

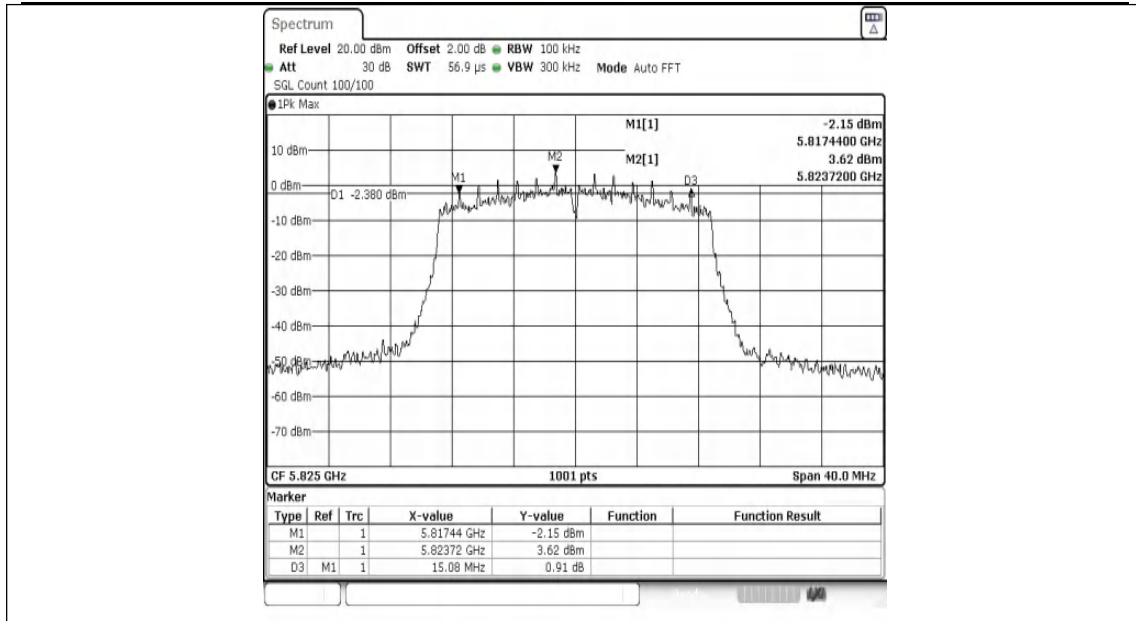


11AC20MIMO-Ant1-5825-PASS

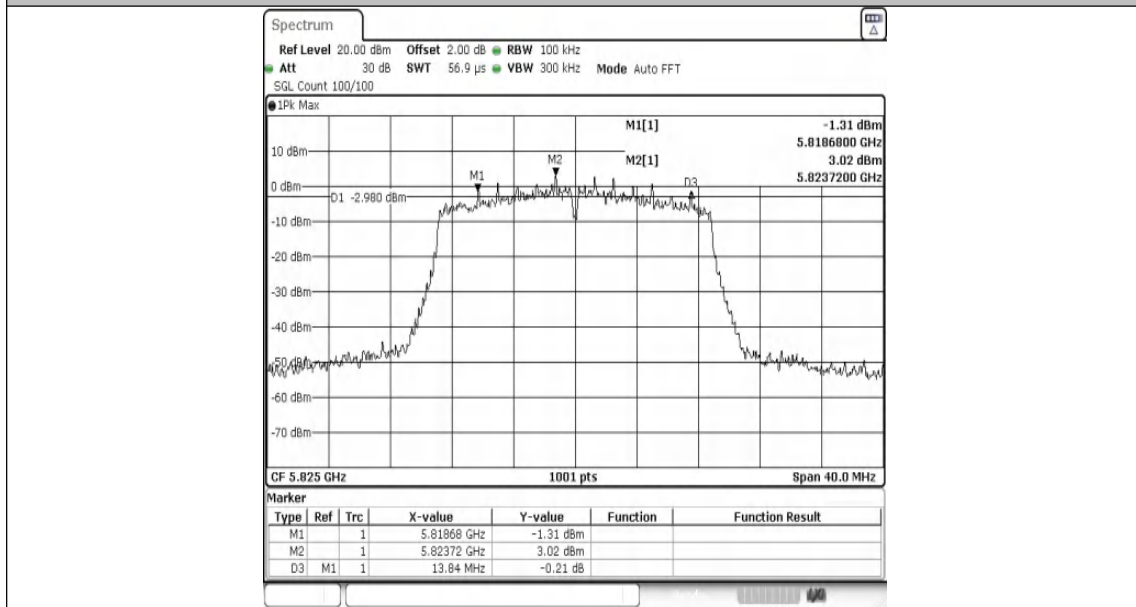


11AC20MIMO-Ant2-5825-PASS

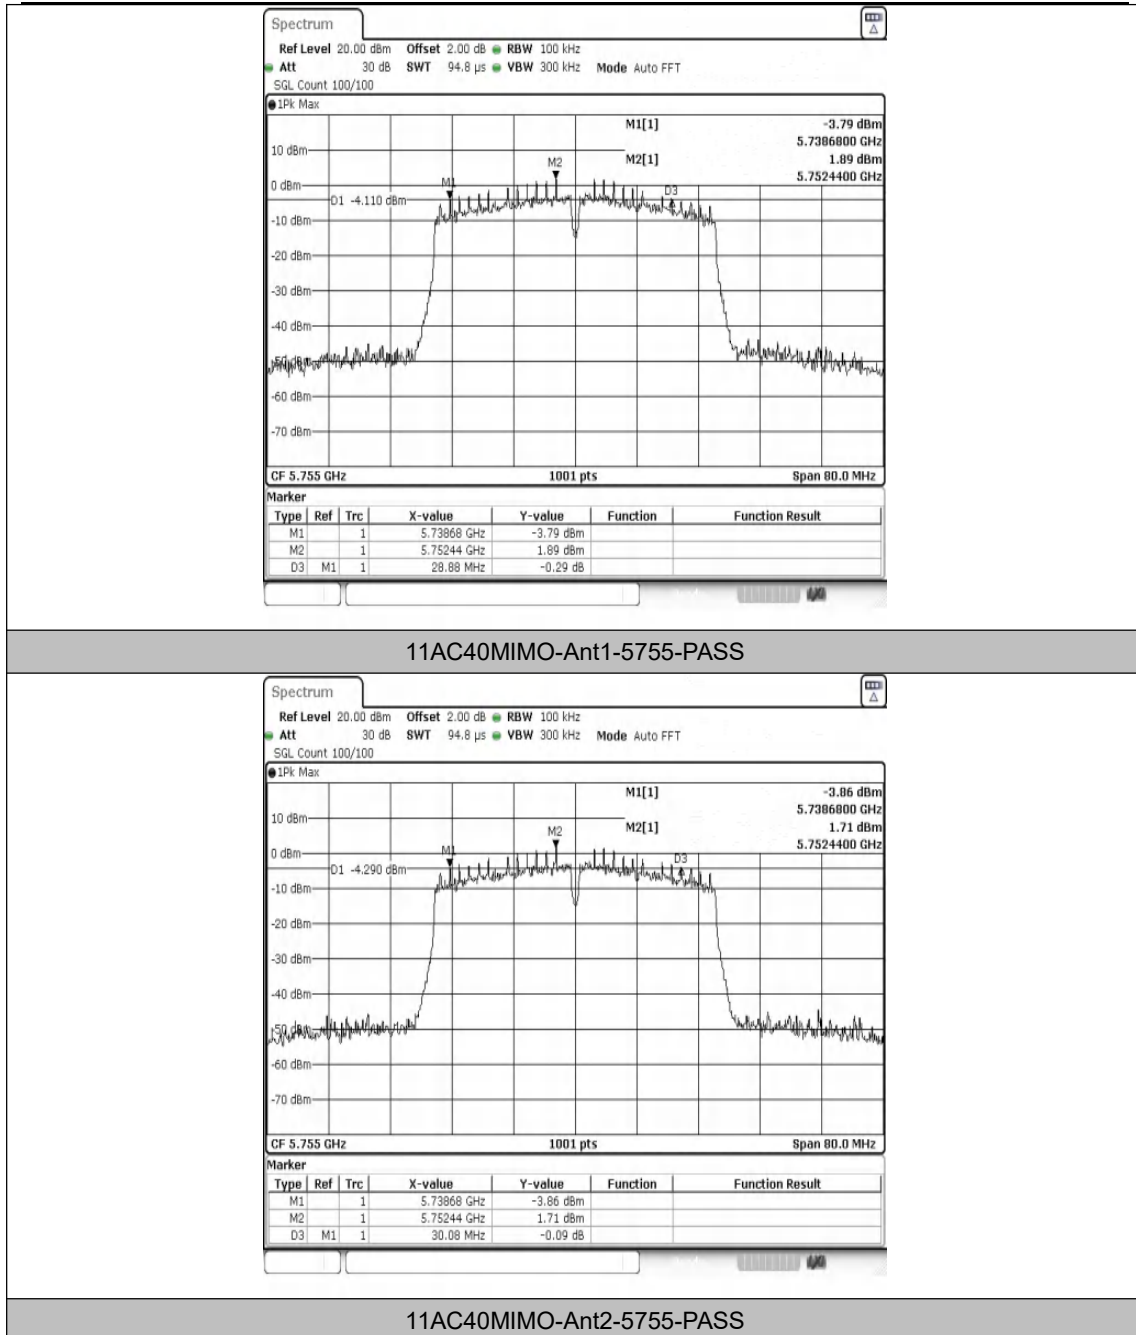


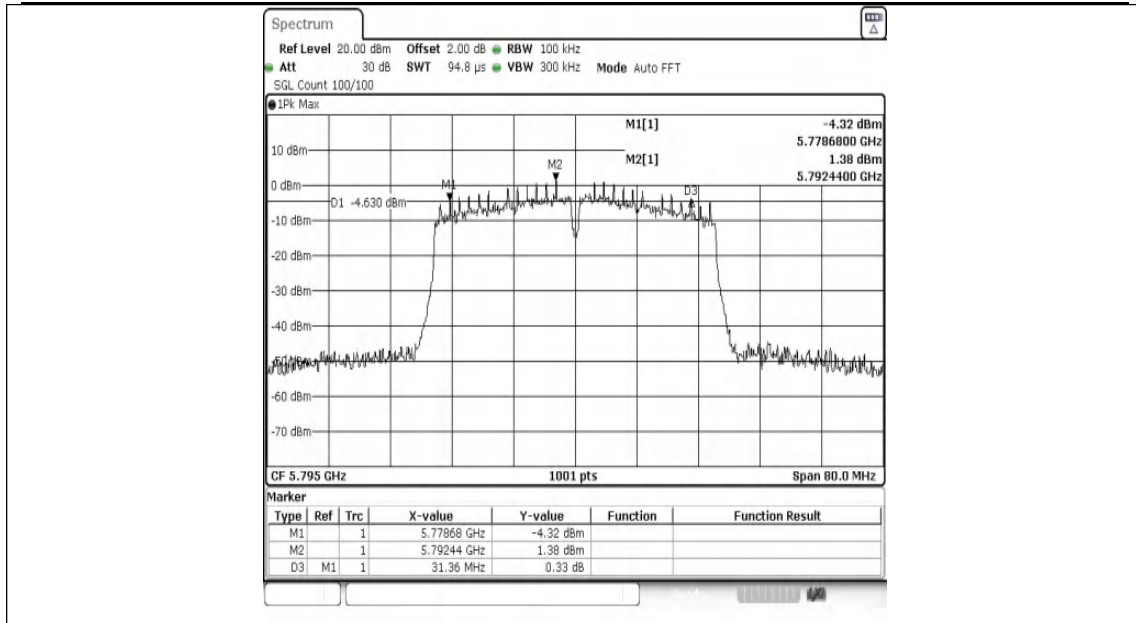

11AC40MIMO-Ant1-5795-PASS

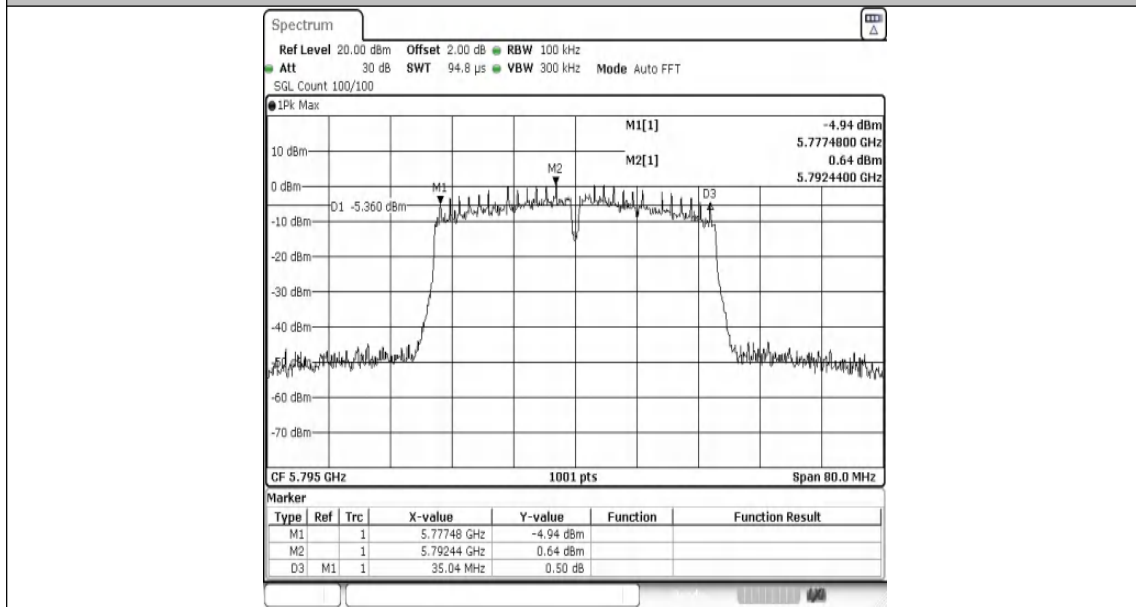

11AC40MIMO-Ant2-5795-PASS

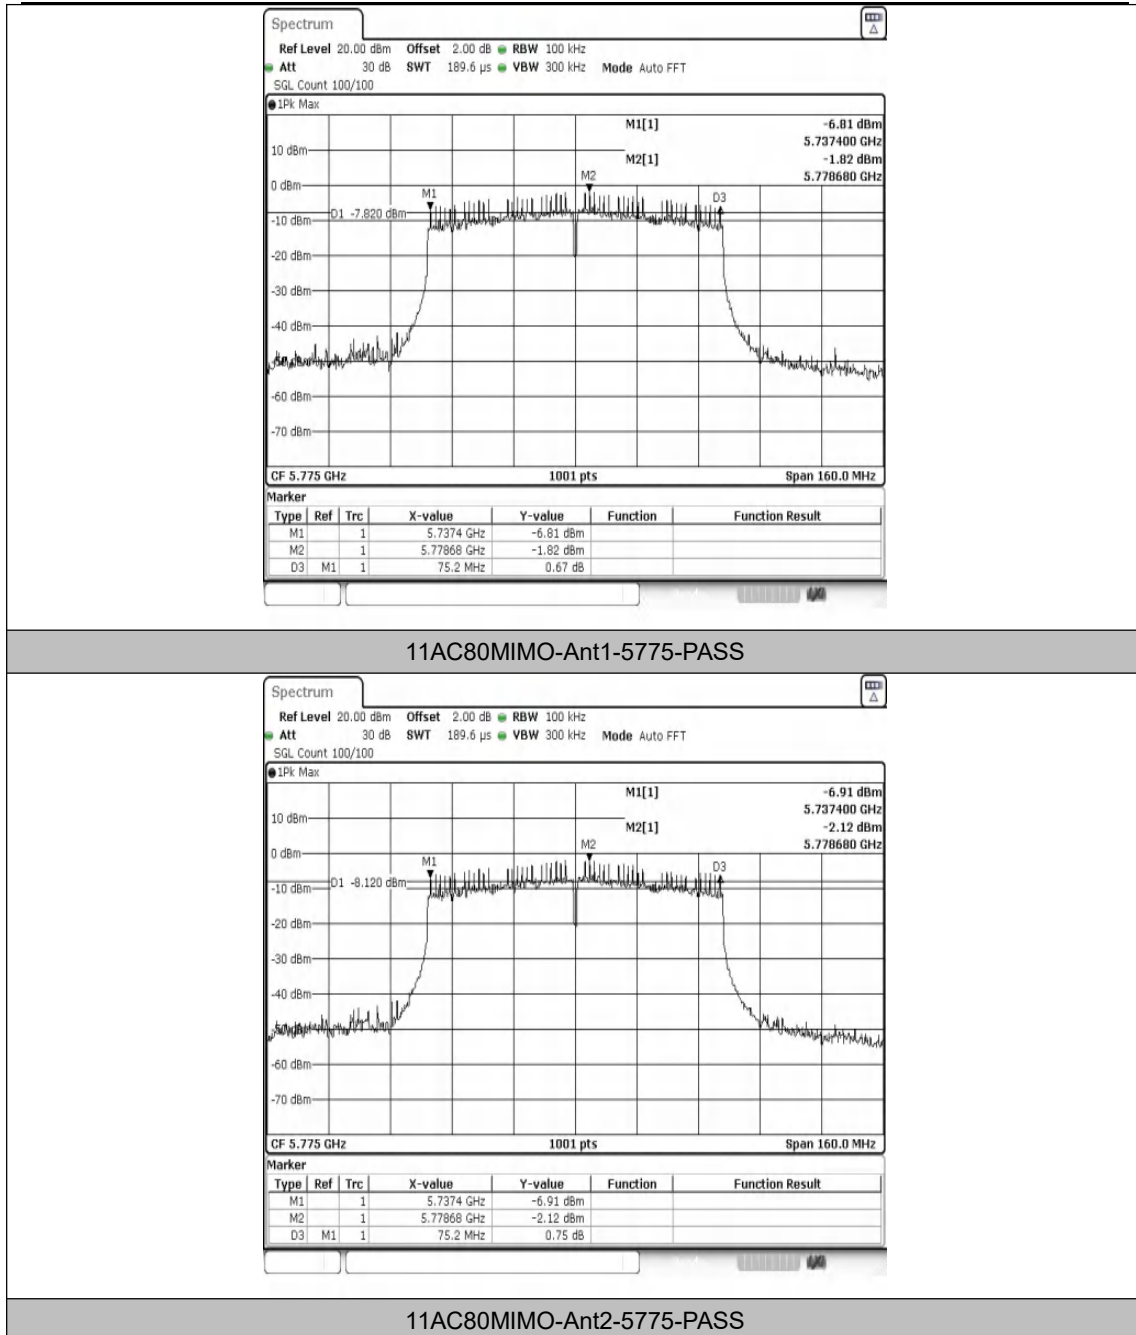

Appendix B: Duty Cycle

Test Result

Test Mode	Antenna	Frequency[MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Dc Factor [dB]	1/T
11A	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11A	Ant2	5180	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5200	100.00	100.00	100.00	0.00	0.01
11A	Ant2	5200	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11A	Ant2	5240	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11A	Ant2	5745	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11A	Ant2	5785	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11A	Ant2	5825	100.00	100.00	100.00	0.00	0.01
11N20MIMO	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11N20MIMO	Ant2	5180	100.00	100.00	100.00	0.00	0.01
11N20MIMO	Ant1	5200	100.00	100.00	100.00	0.00	0.01
11N20MIMO	Ant2	5200	100.00	100.00	100.00	0.00	0.01
11N20MIMO	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11N20MIMO	Ant2	5240	100.00	100.00	100.00	0.00	0.01
11N20MIMO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11N20MIMO	Ant2	5745	100.00	100.00	100.00	0.00	0.01
11N20MIMO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11N20MIMO	Ant2	5785	100.00	100.00	100.00	0.00	0.01
11N20MIMO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11N20MIMO	Ant2	5825	100.00	100.00	100.00	0.00	0.01
11N40MIMO	Ant1	5190	100.00	100.00	100.00	0.00	0.01
11N40MIMO	Ant2	5190	100.00	100.00	100.00	0.00	0.01
11N40MIMO	Ant1	5230	100.00	100.00	100.00	0.00	0.01
11N40MIMO	Ant2	5230	100.00	100.00	100.00	0.00	0.01
11N40MIMO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11N40MIMO	Ant2	5755	100.00	100.00	100.00	0.00	0.01
11N40MIMO	Ant1	5795	100.00	100.00	100.00	0.00	0.01
11N40MIMO	Ant2	5795	100.00	100.00	100.00	0.00	0.01
11AC20MIMO	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11AC20MIMO	Ant2	5180	100.00	100.00	100.00	0.00	0.01
11AC20MIMO	Ant1	5200	100.00	100.00	100.00	0.00	0.01
11AC20MIMO	Ant2	5200	100.00	100.00	100.00	0.00	0.01


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AC20MIMO	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11AC20MIMO	Ant2	5240	100.00	100.00	100.00	0.00	0.01
11AC20MIMO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11AC20MIMO	Ant2	5745	100.00	100.00	100.00	0.00	0.01
11AC20MIMO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11AC20MIMO	Ant2	5785	100.00	100.00	100.00	0.00	0.01
11AC20MIMO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11AC20MIMO	Ant2	5825	100.00	100.00	100.00	0.00	0.01
11AC40MIMO	Ant1	5190	100.00	100.00	100.00	0.00	0.01
11AC40MIMO	Ant2	5190	100.00	100.00	100.00	0.00	0.01
11AC40MIMO	Ant1	5230	100.00	100.00	100.00	0.00	0.01
11AC40MIMO	Ant2	5230	100.00	100.00	100.00	0.00	0.01
11AC40MIMO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11AC40MIMO	Ant2	5755	100.00	100.00	100.00	0.00	0.01
11AC40MIMO	Ant1	5795	100.00	100.00	100.00	0.00	0.01
11AC40MIMO	Ant2	5795	100.00	100.00	100.00	0.00	0.01
11AC80MIMO	Ant1	5210	100.00	100.00	100.00	0.00	0.01
11AC80MIMO	Ant2	5210	100.00	100.00	100.00	0.00	0.01
11AC80MIMO	Ant1	5775	100.00	100.00	100.00	0.00	0.01
11AC80MIMO	Ant2	5775	100.00	100.00	100.00	0.00	0.01


Test Graphs

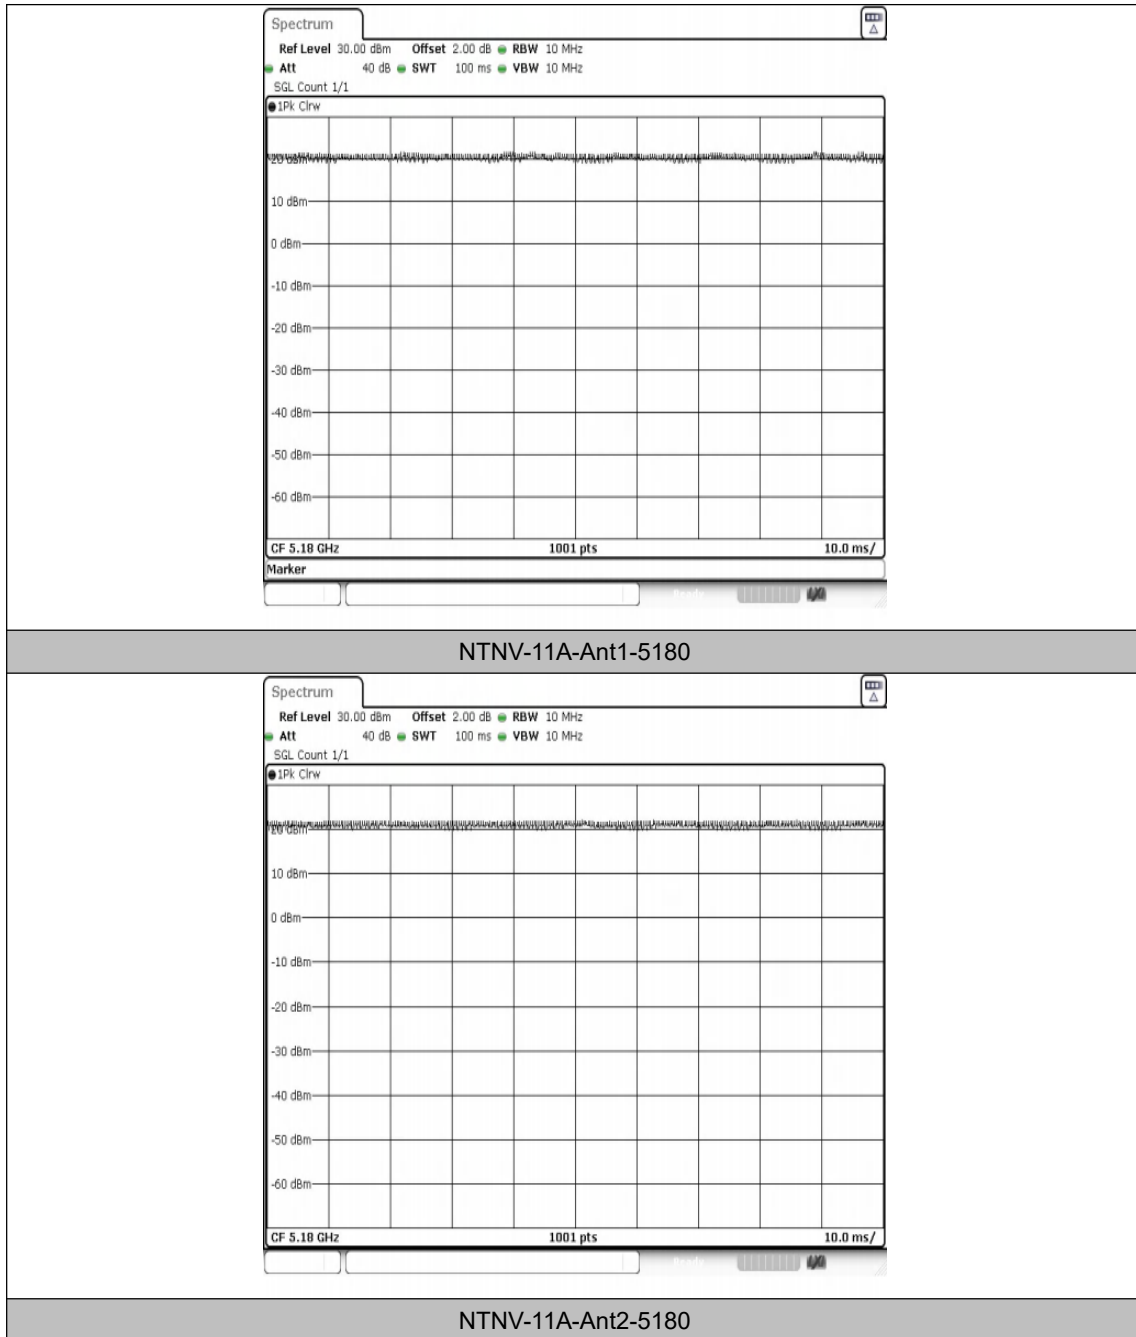



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

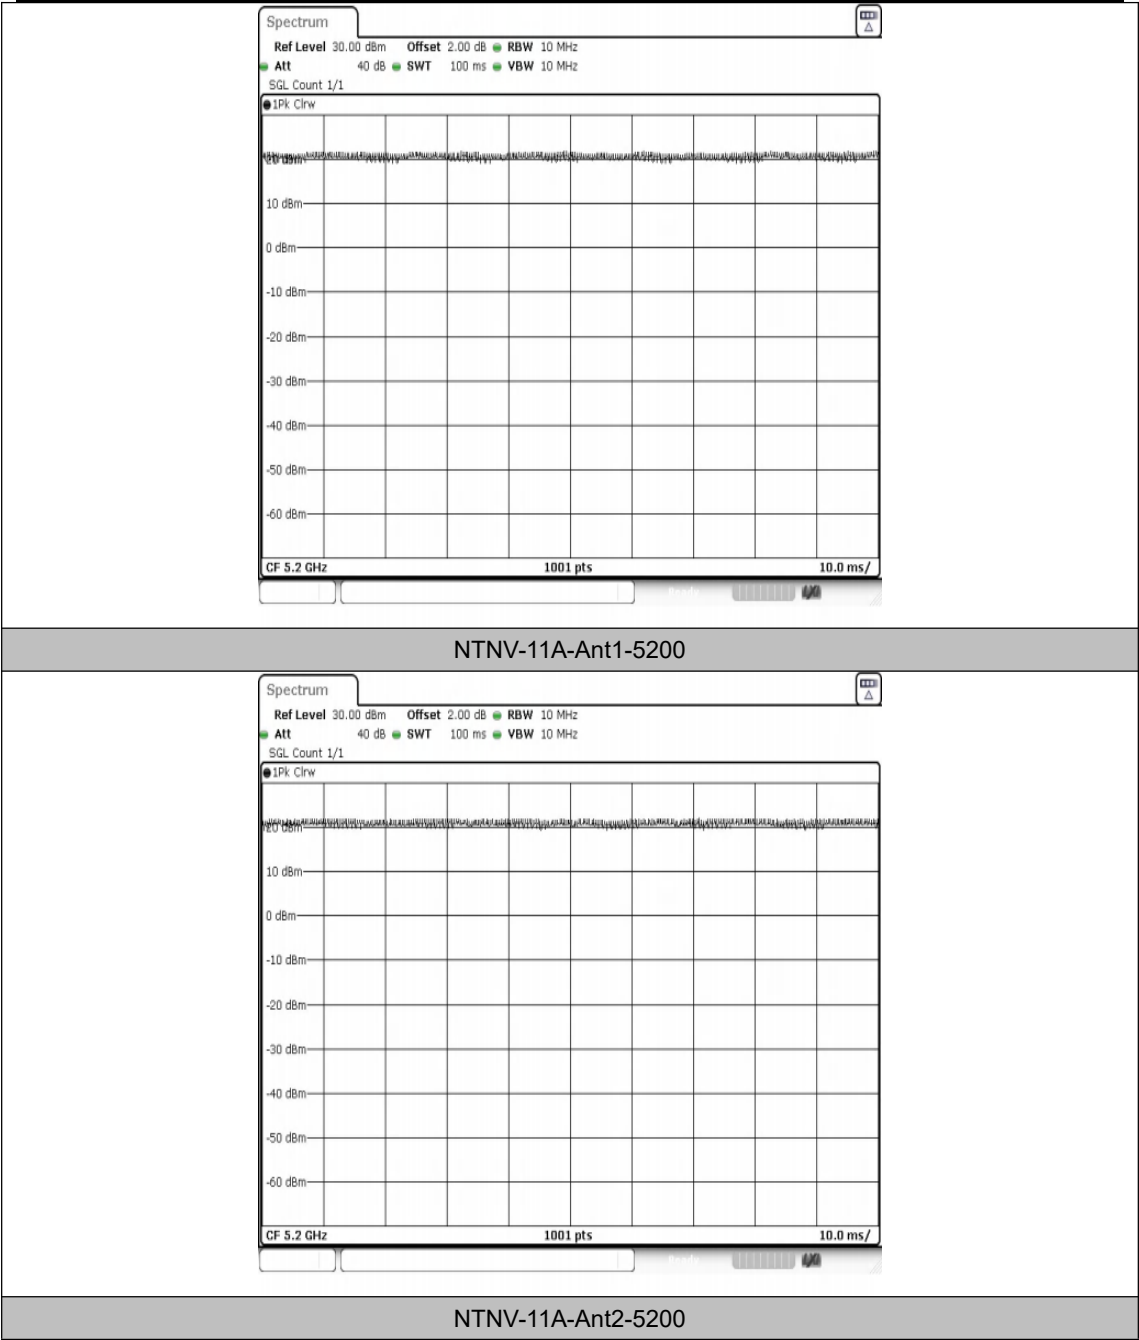

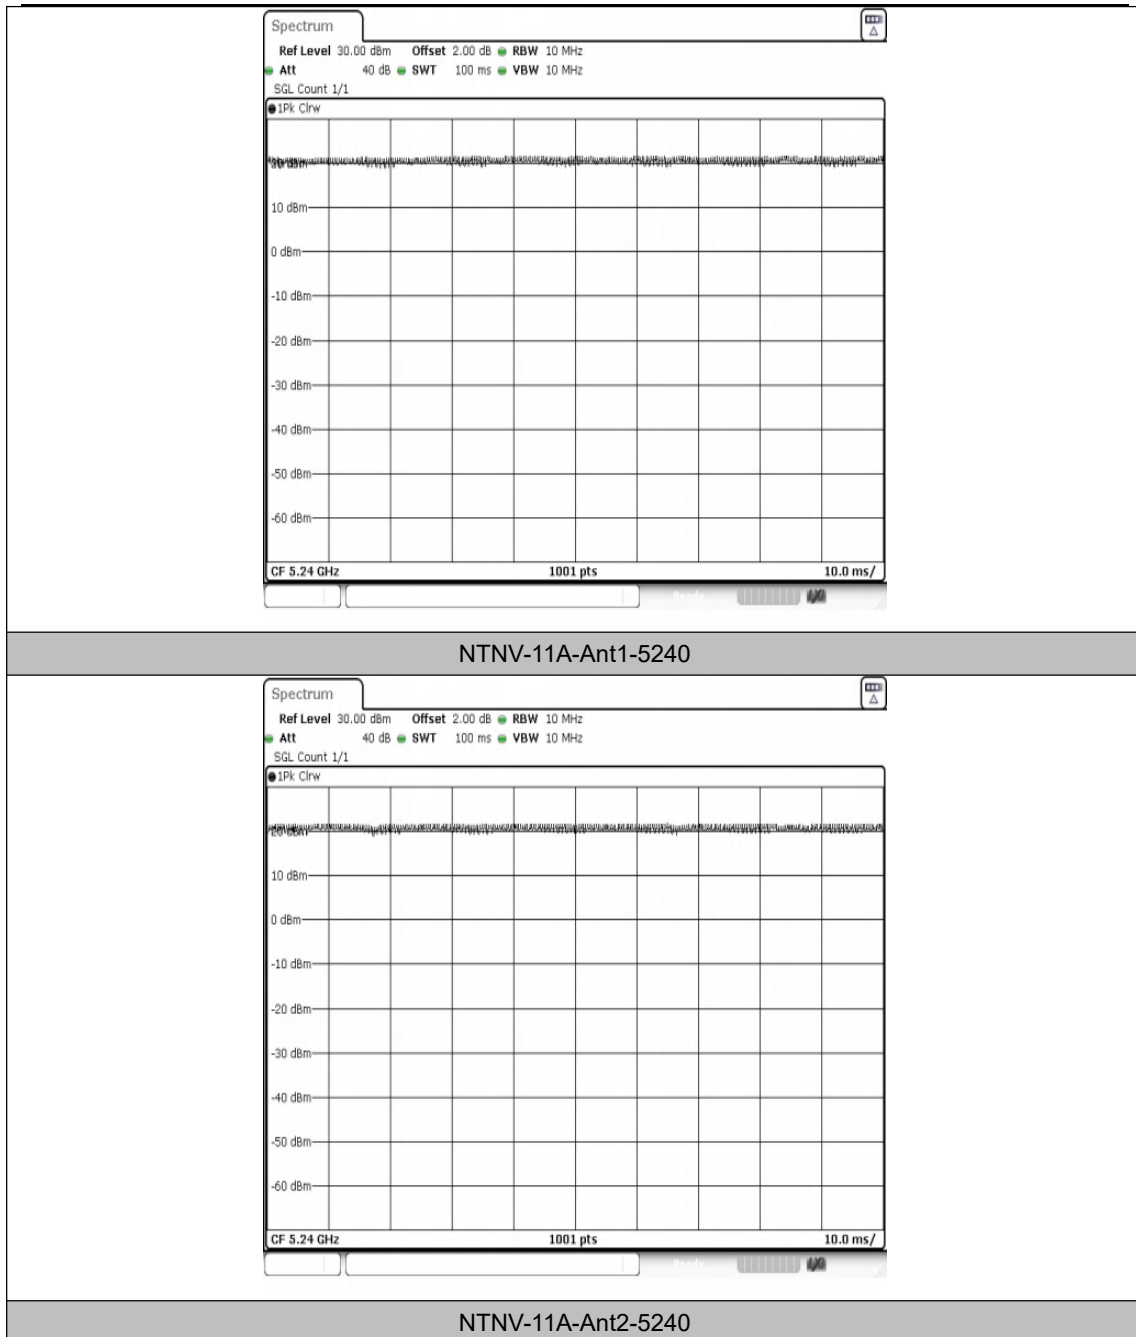

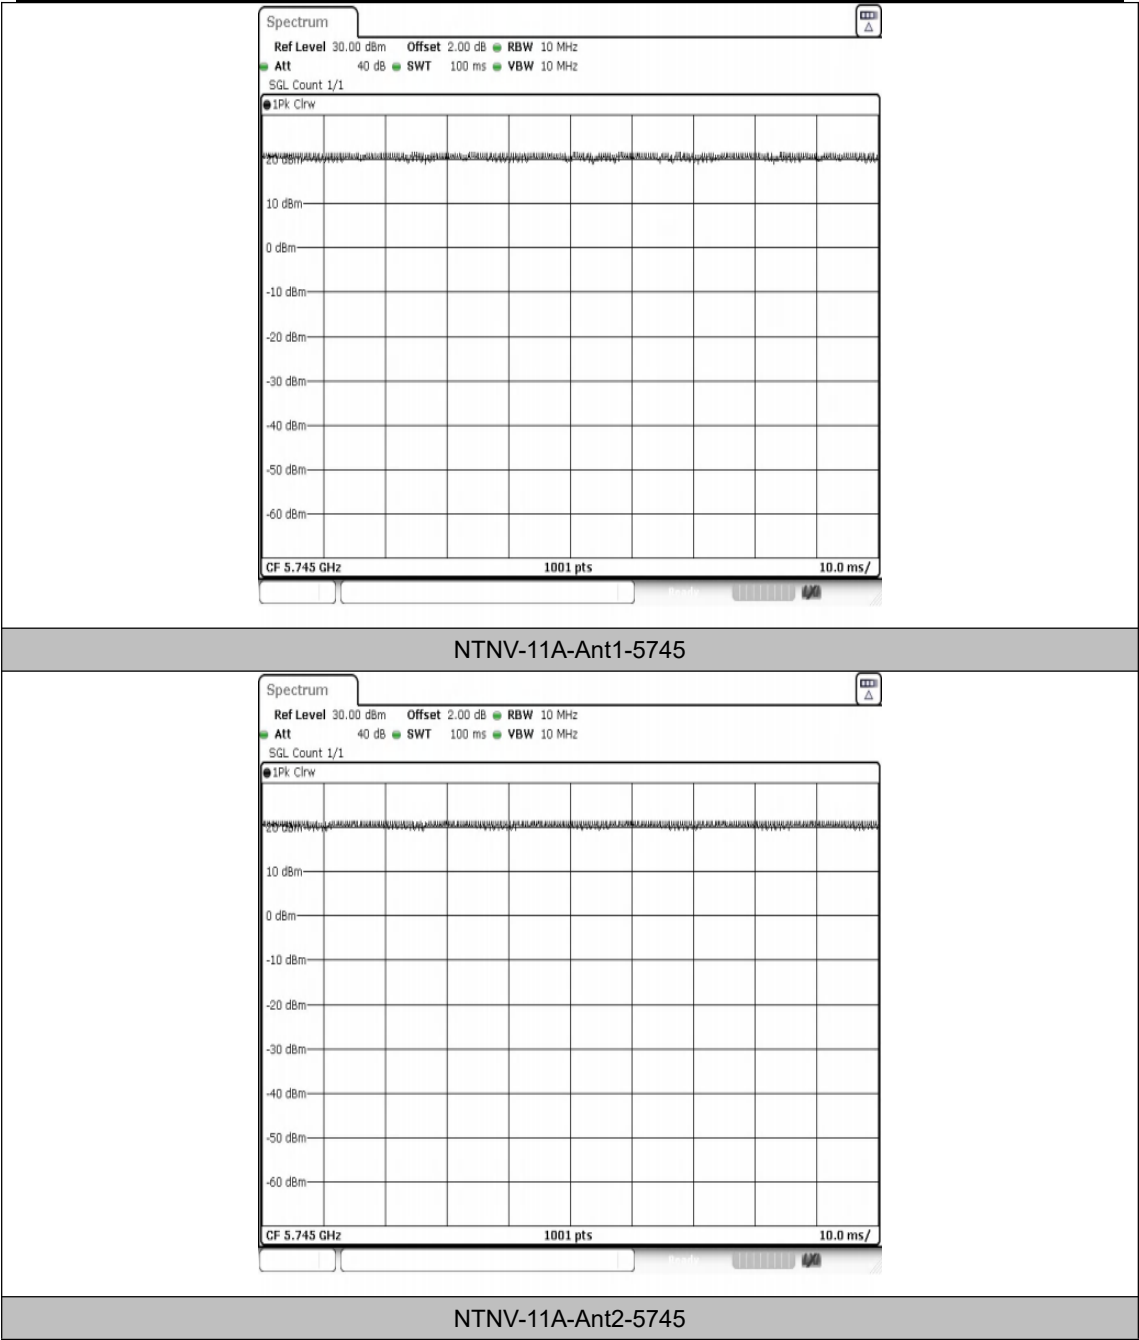


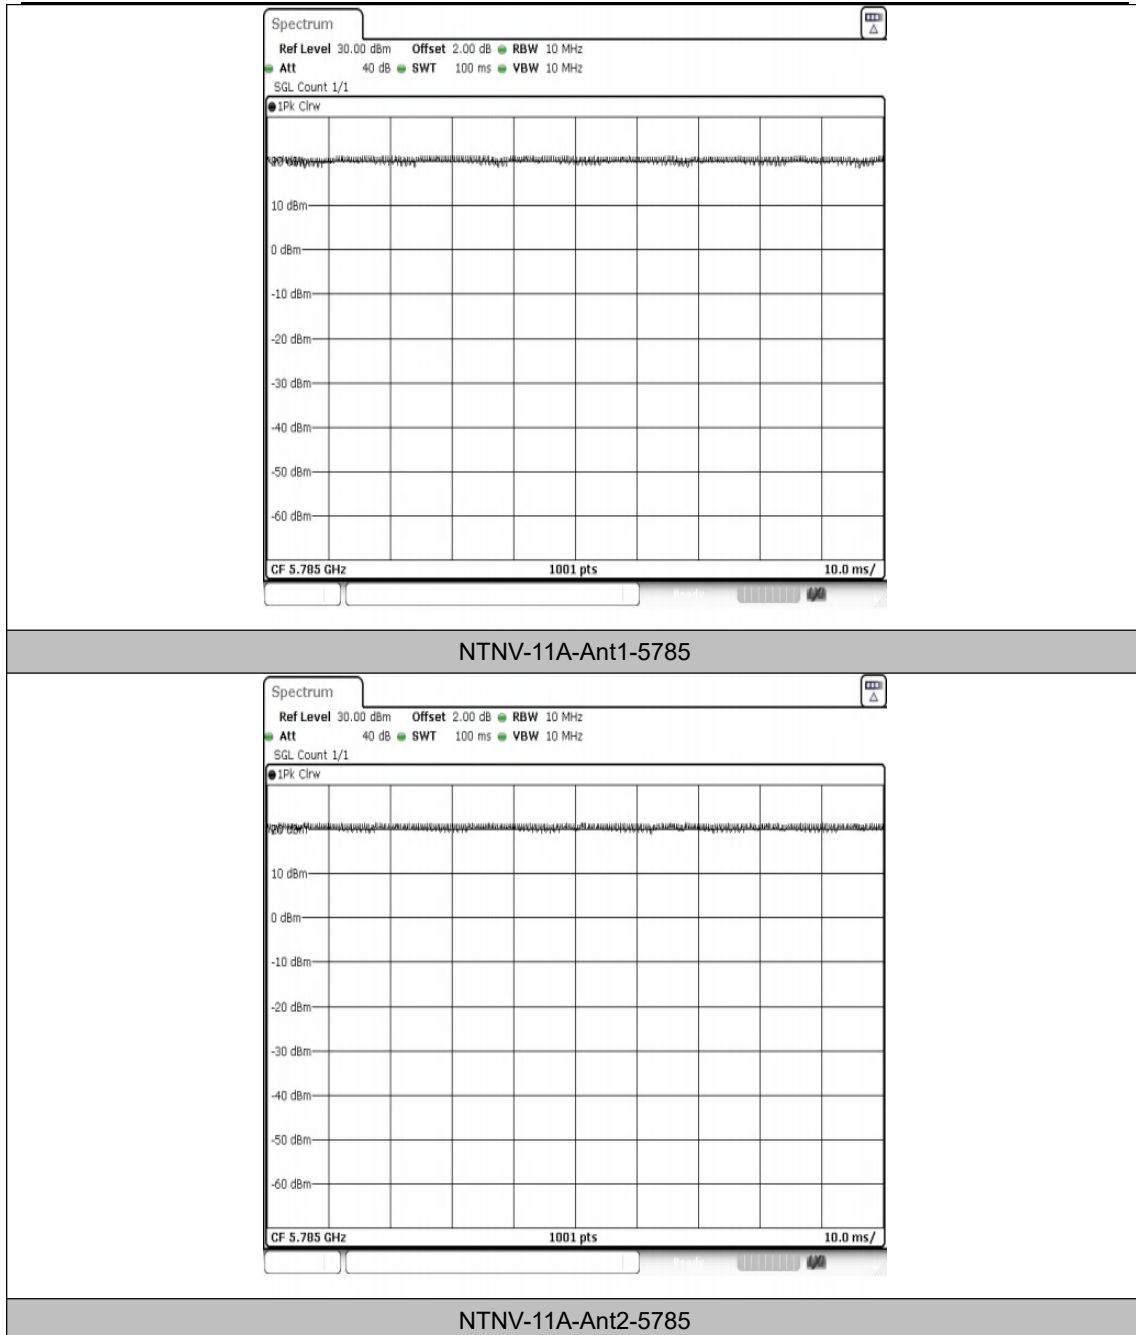

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

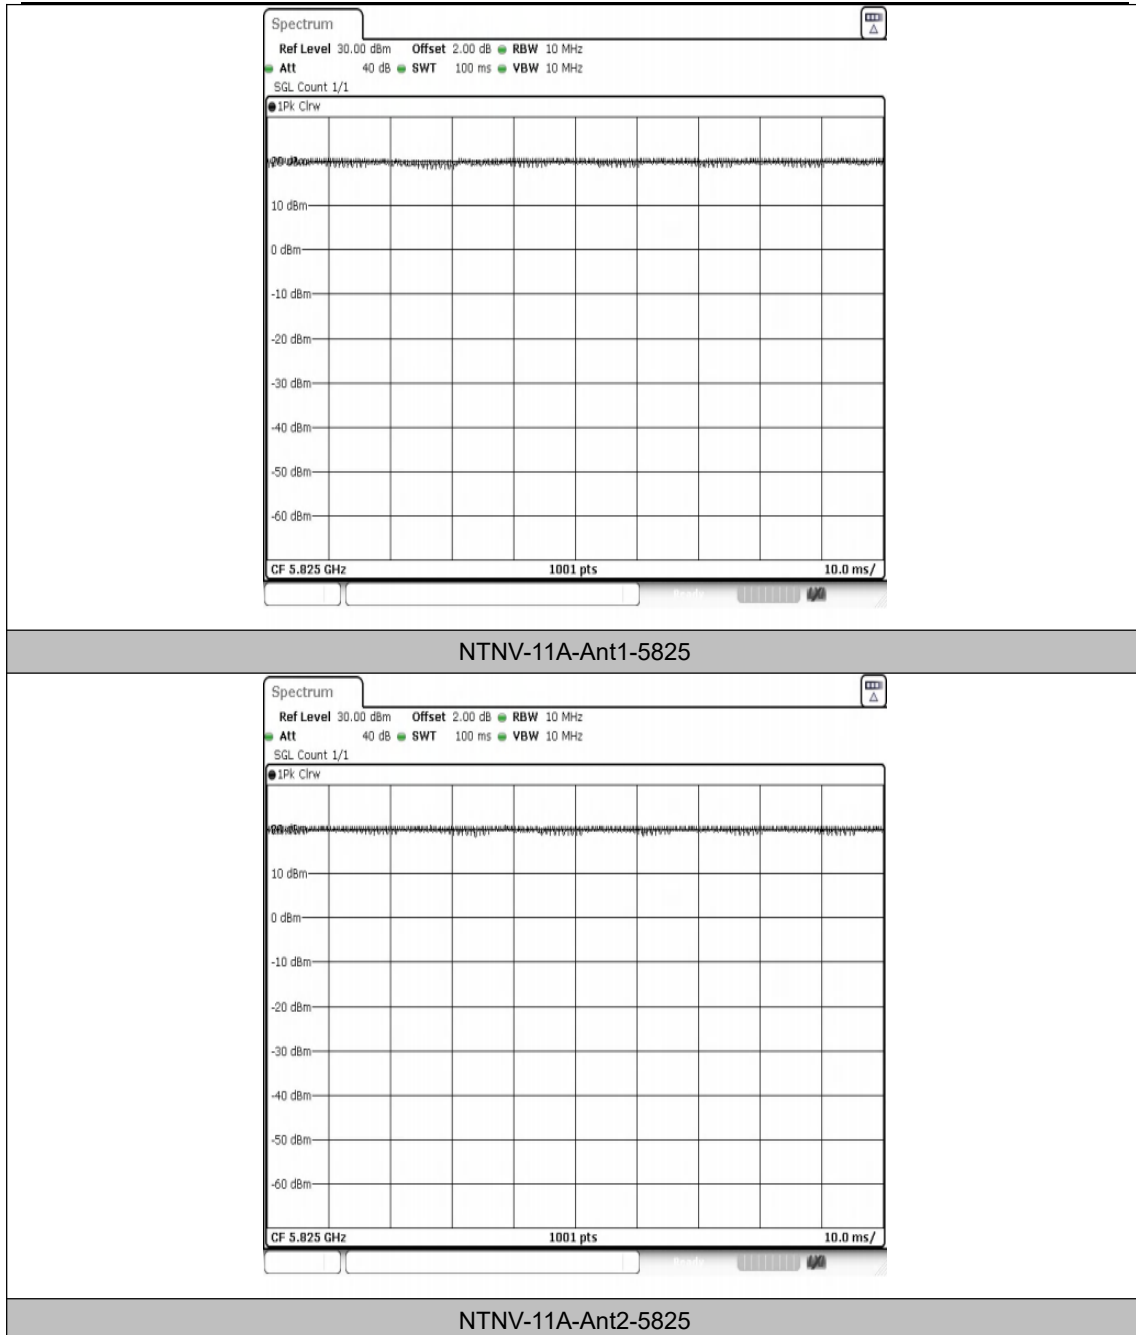

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

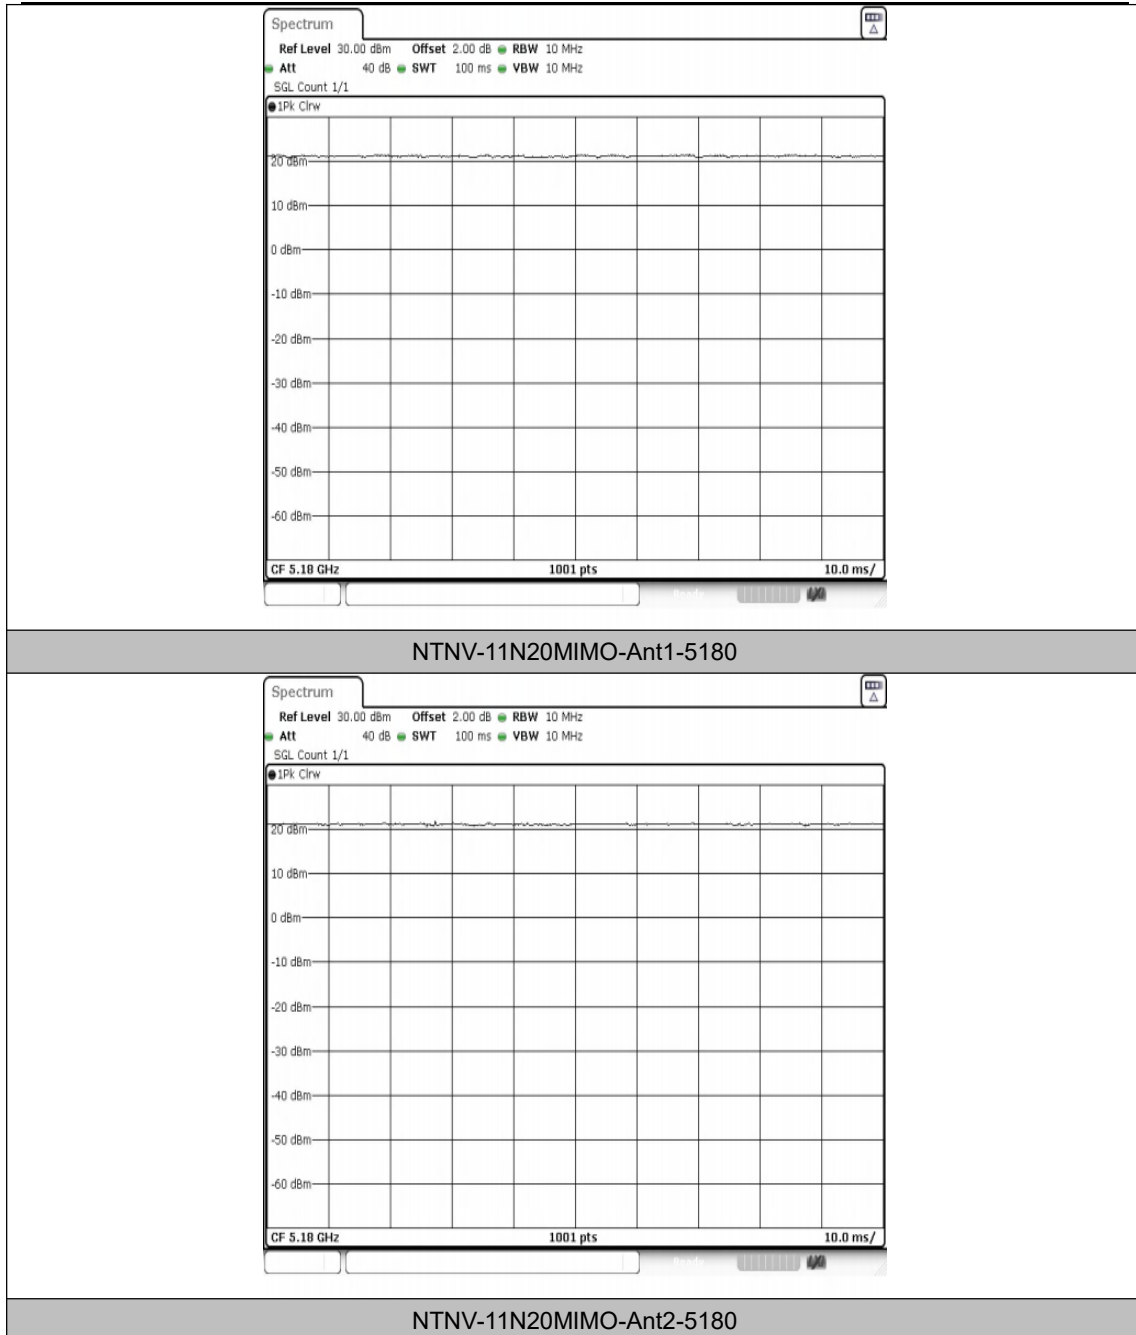

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

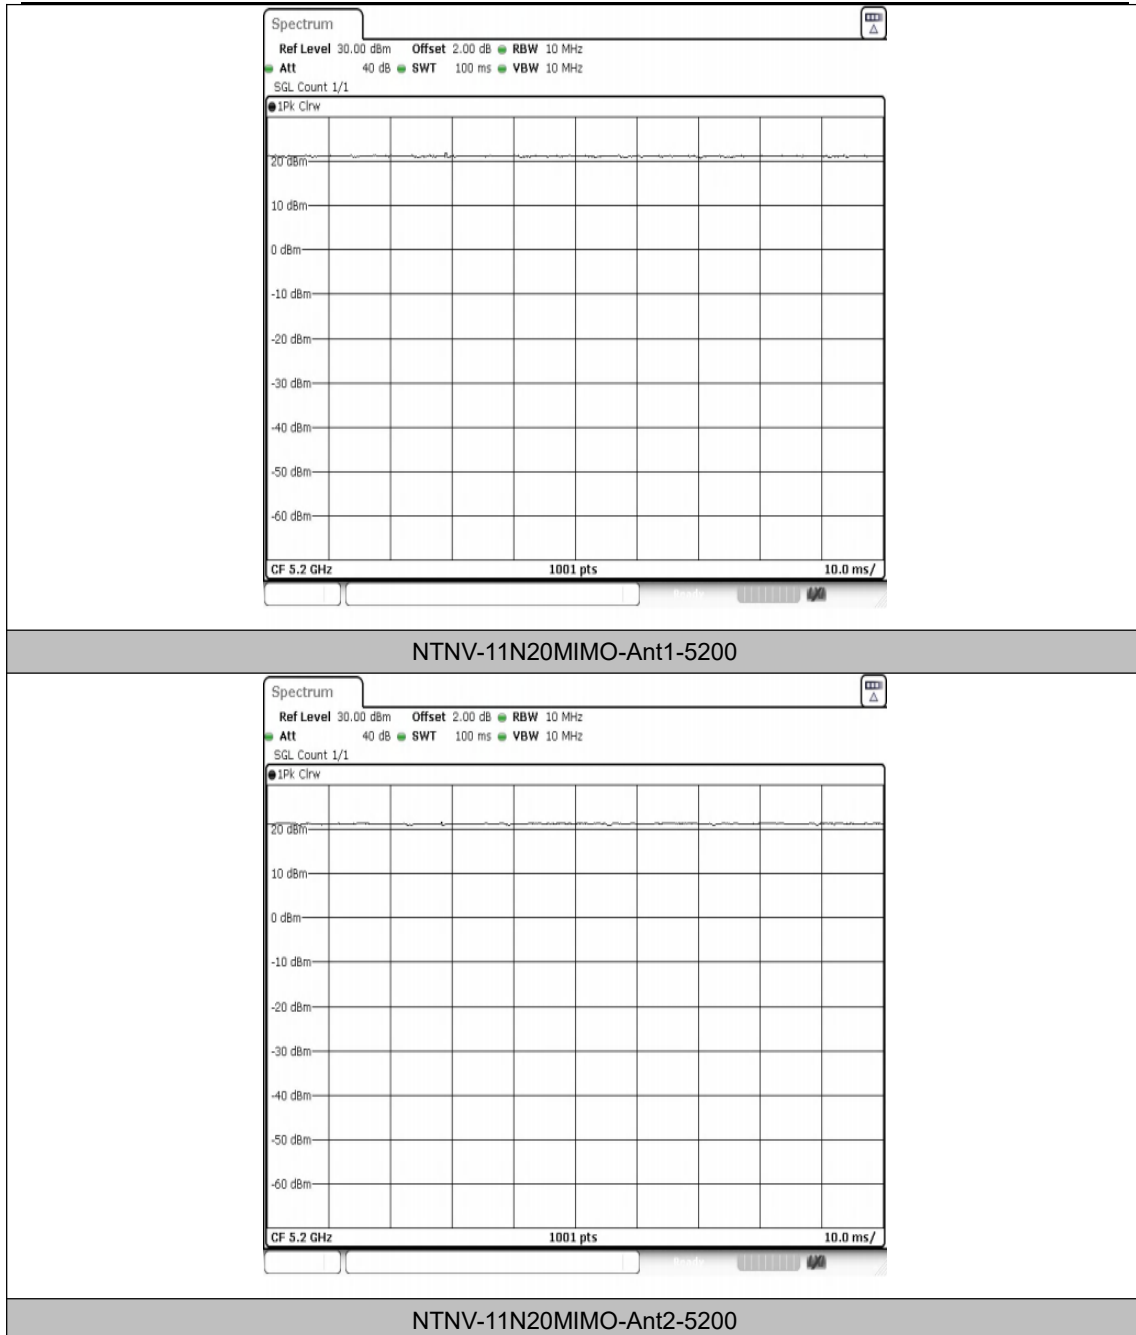

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

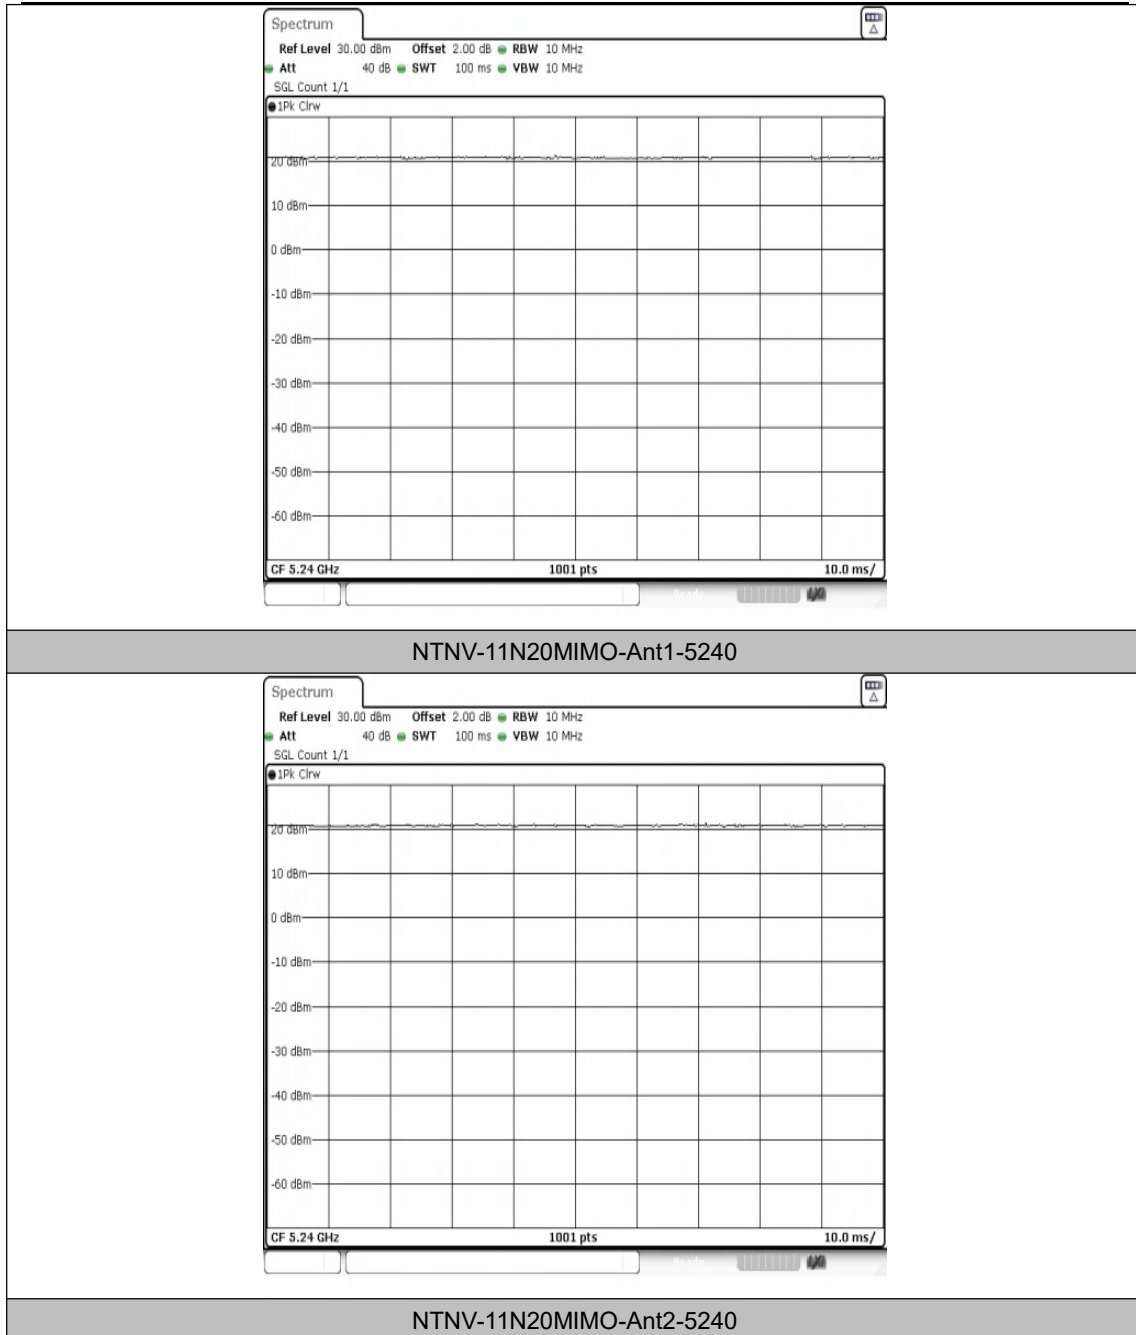

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

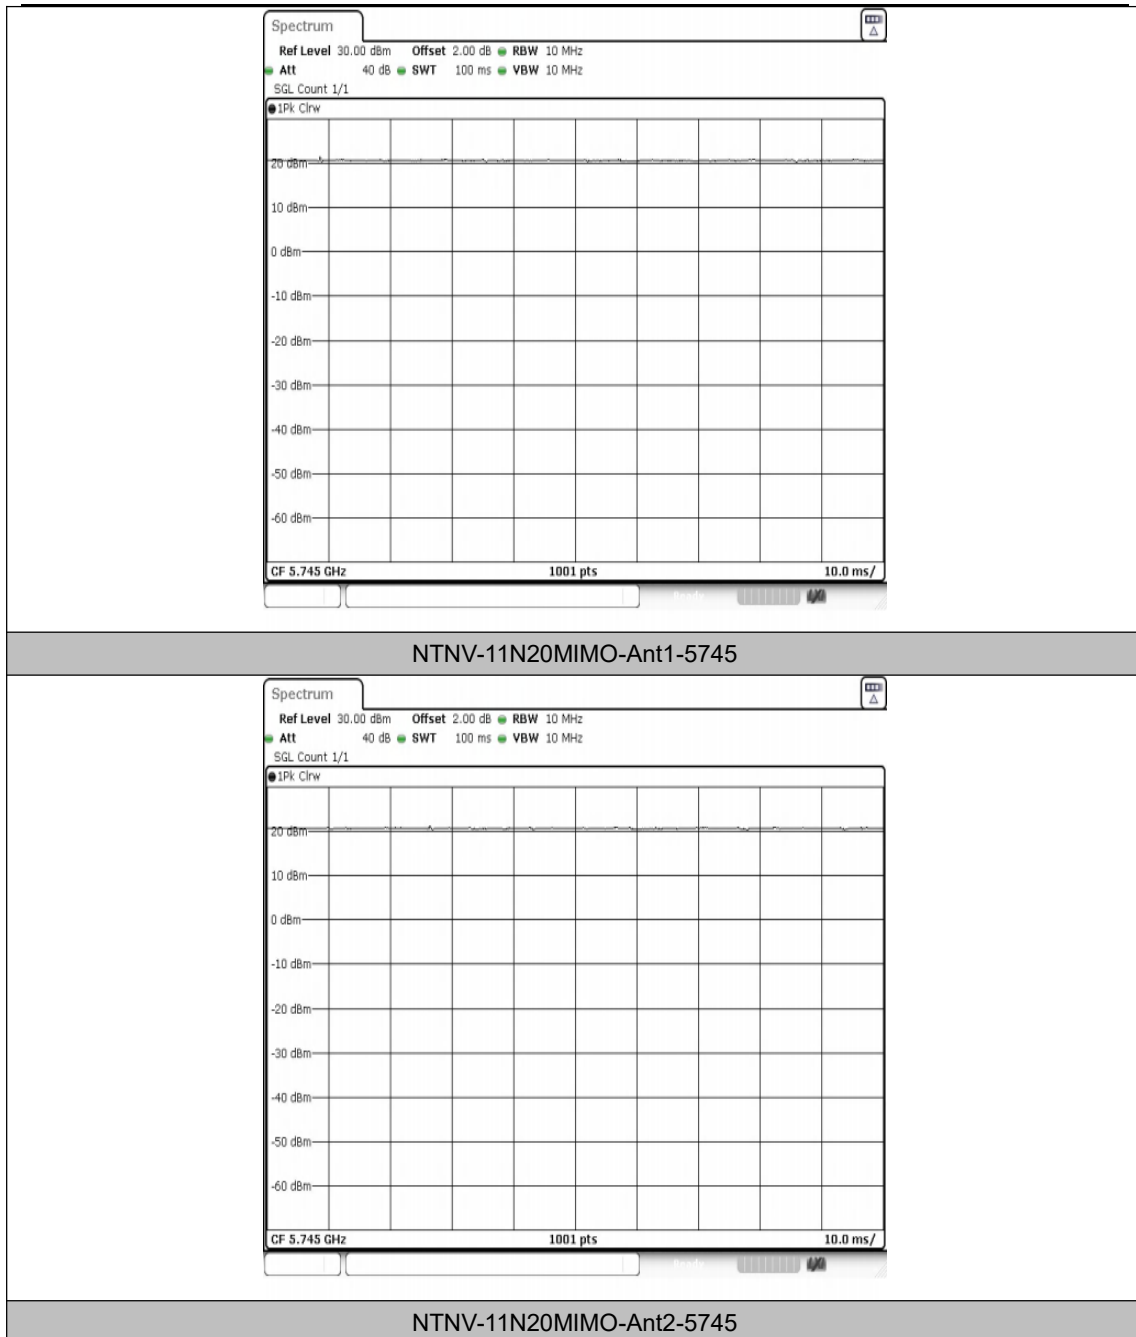


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

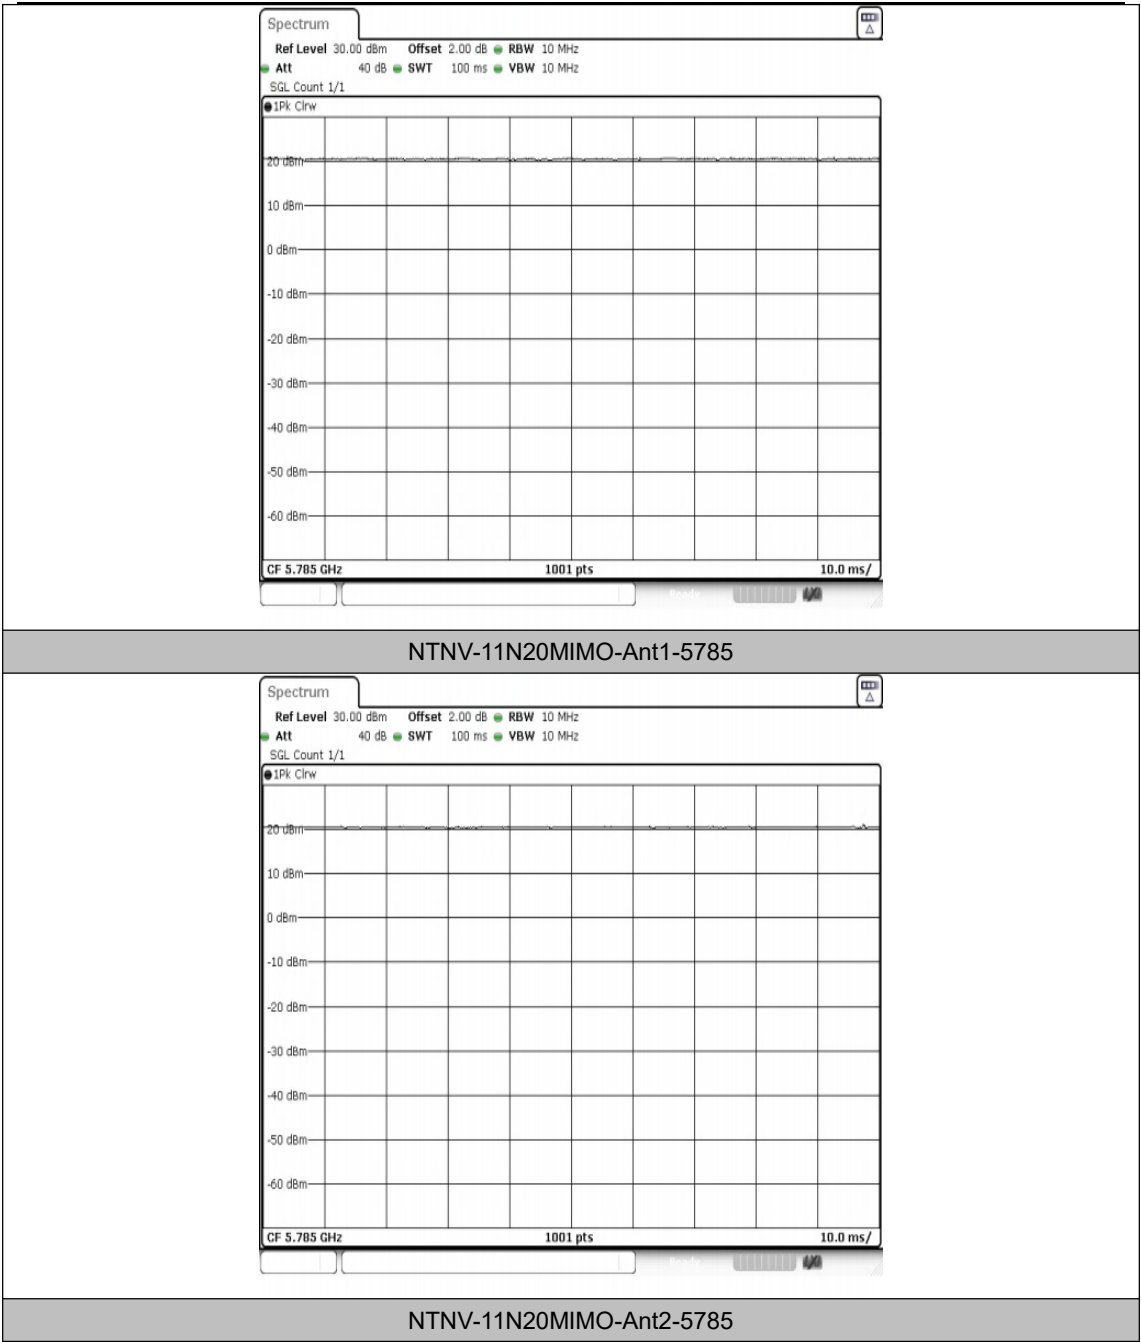


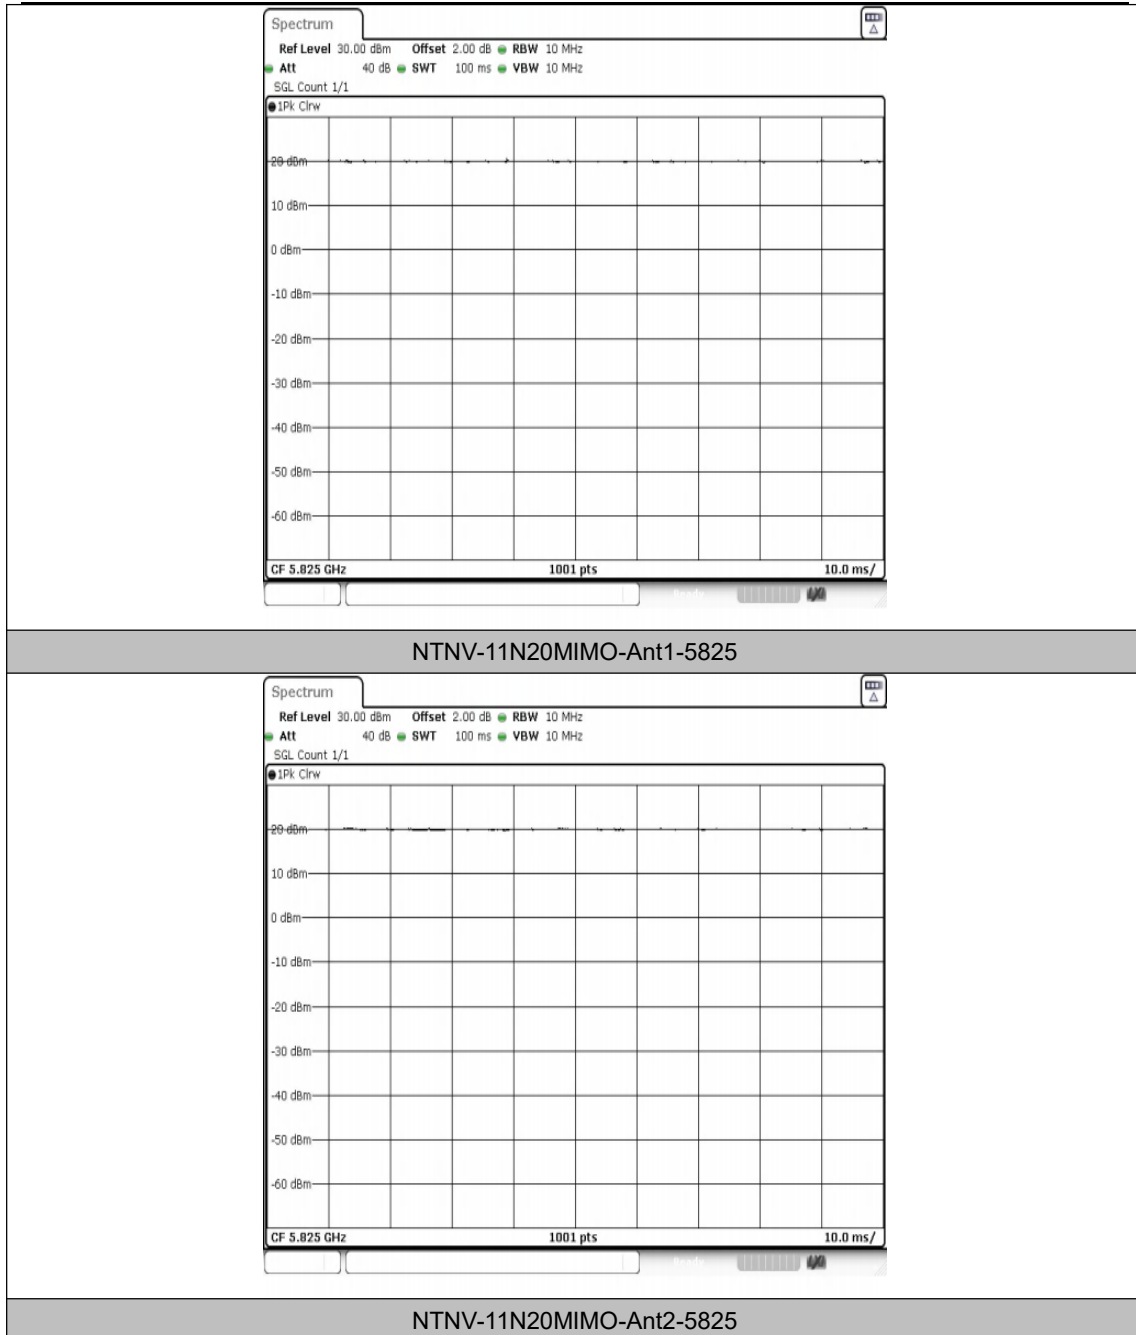

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

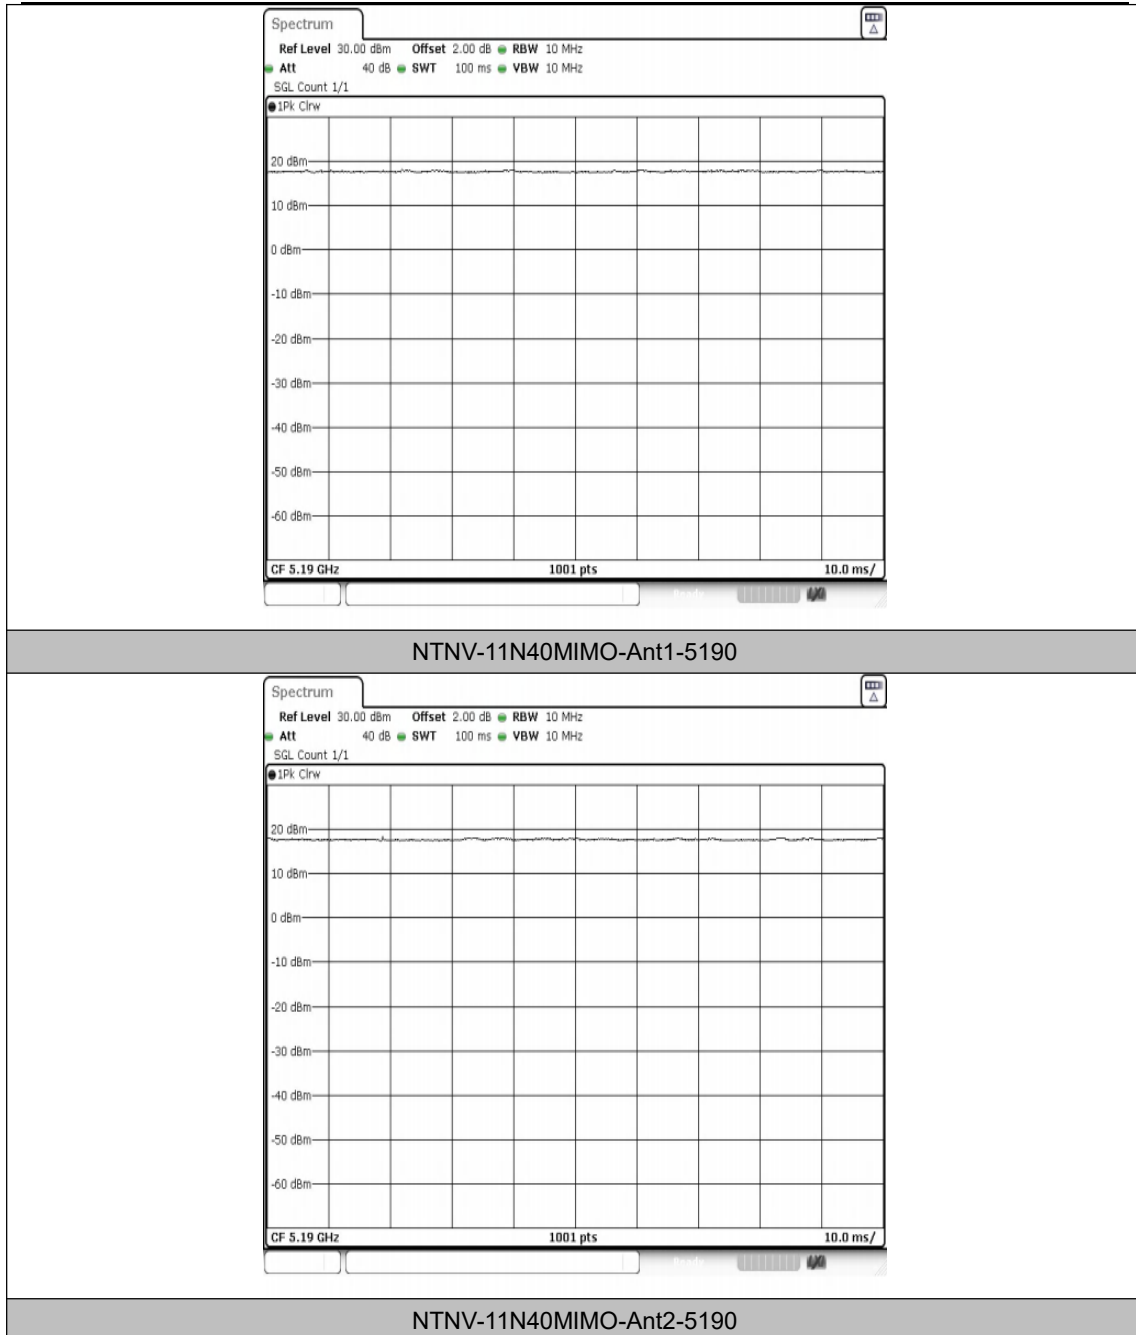

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

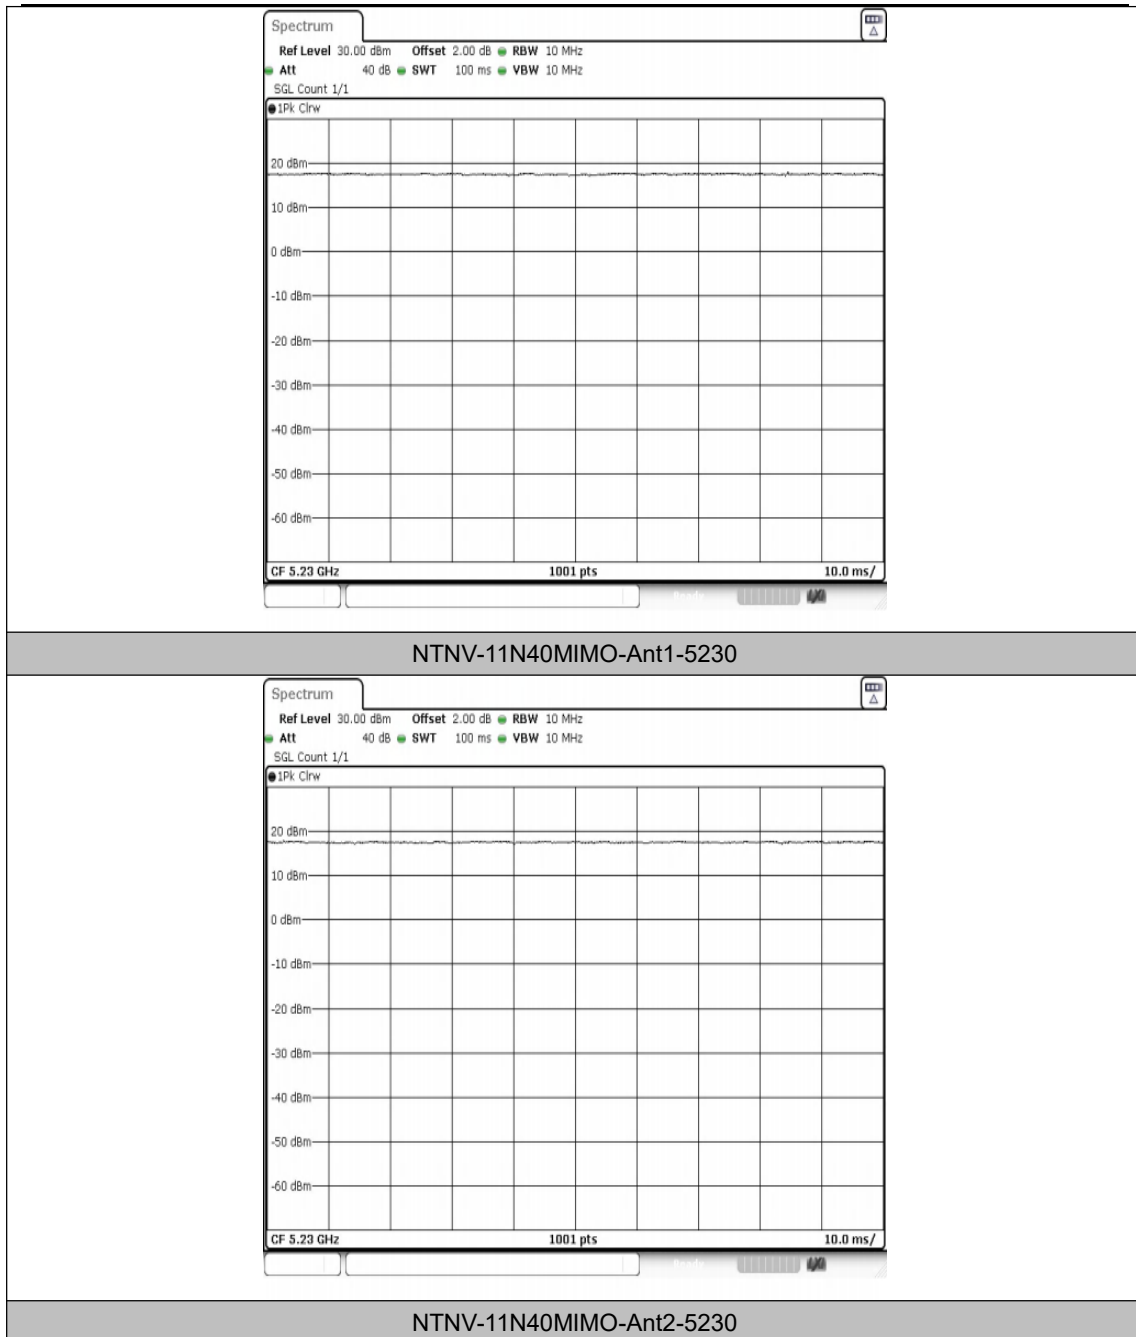

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

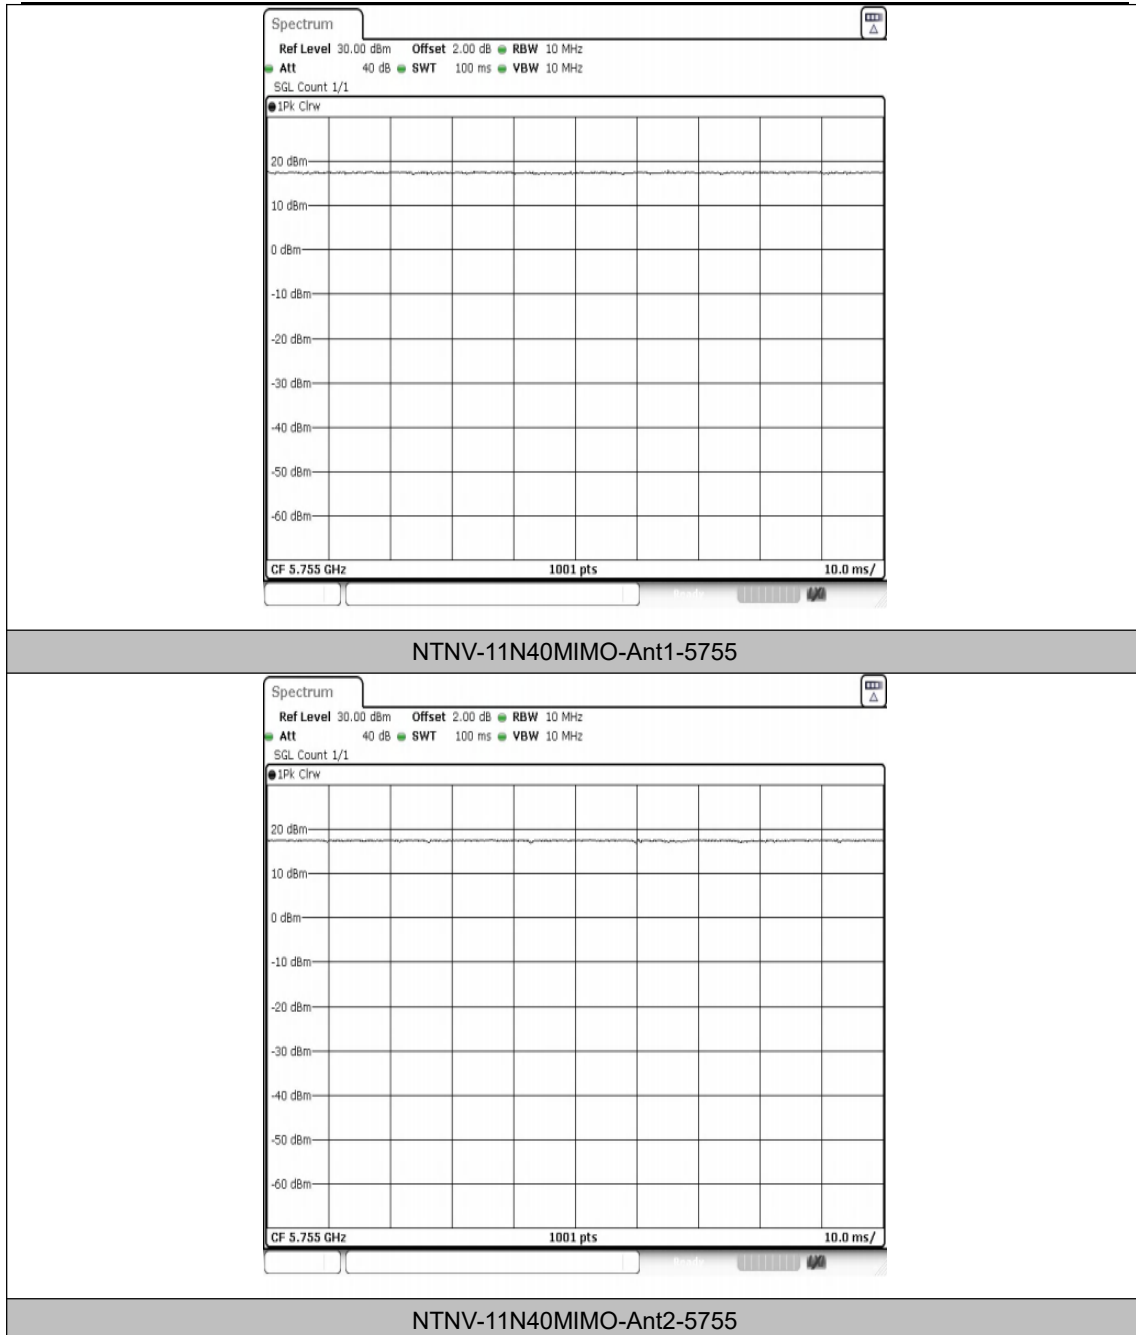

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

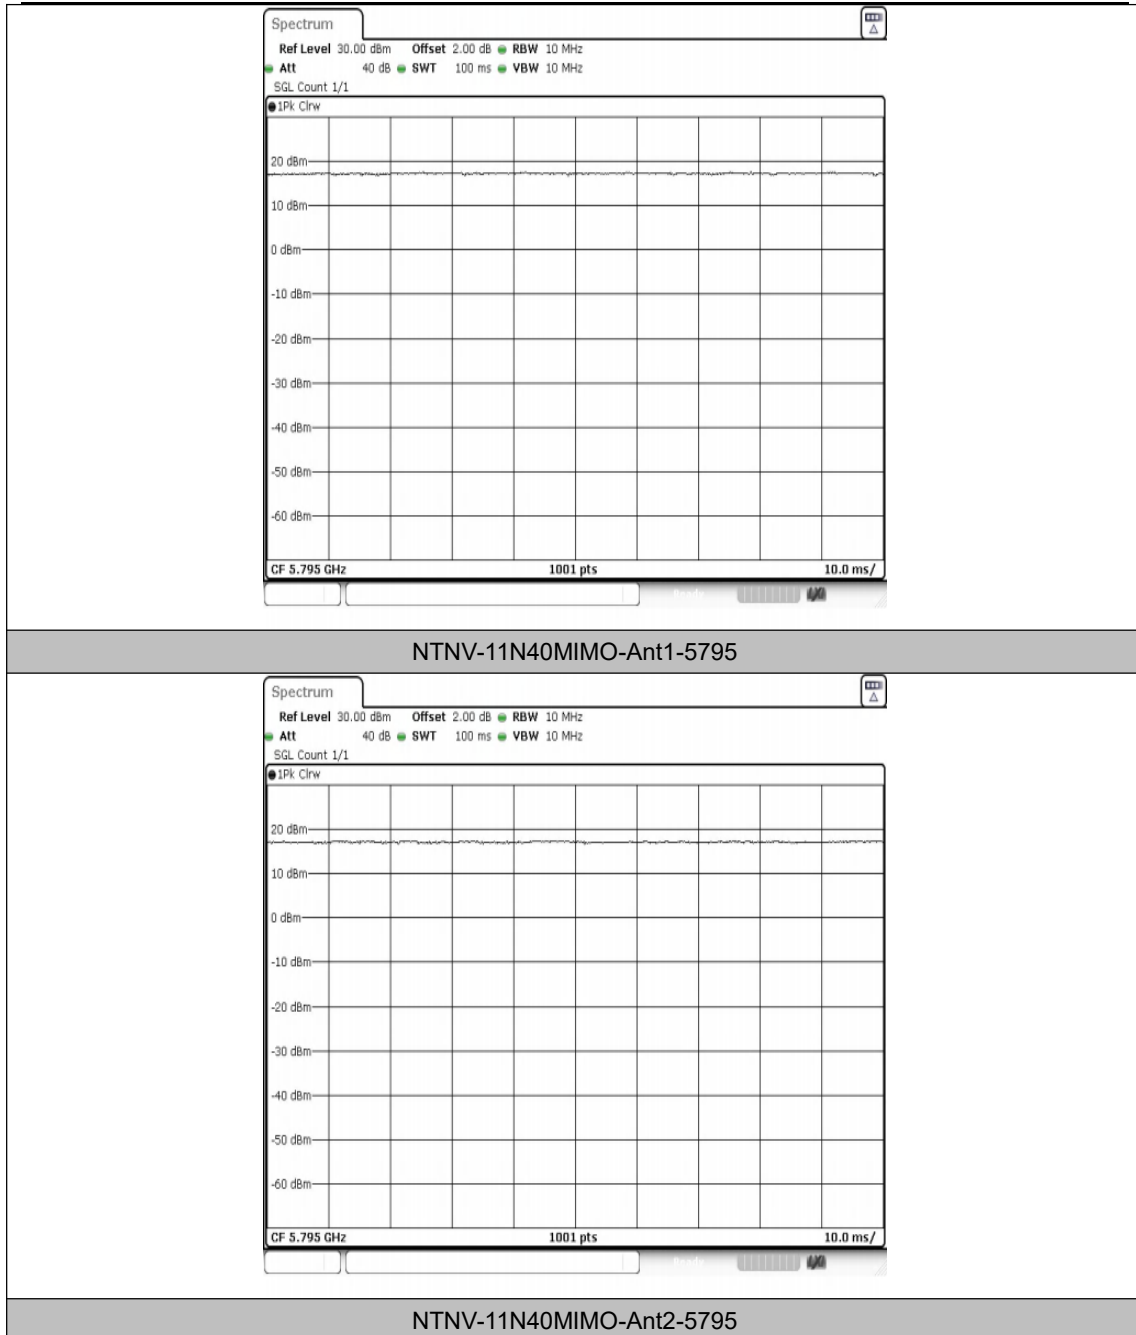



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

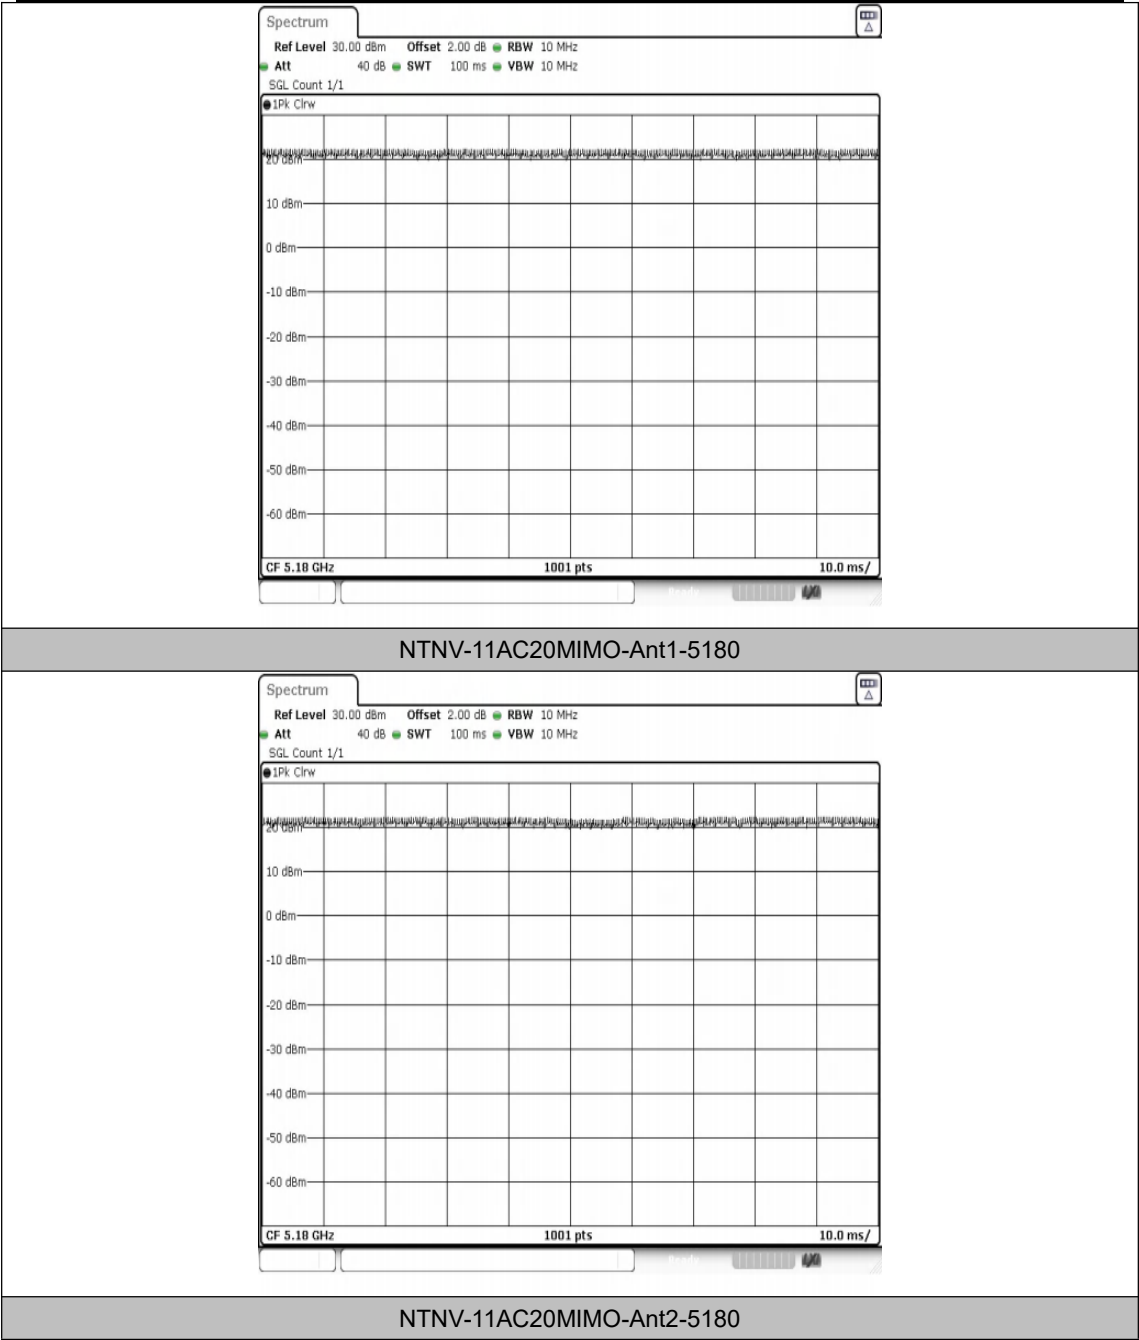

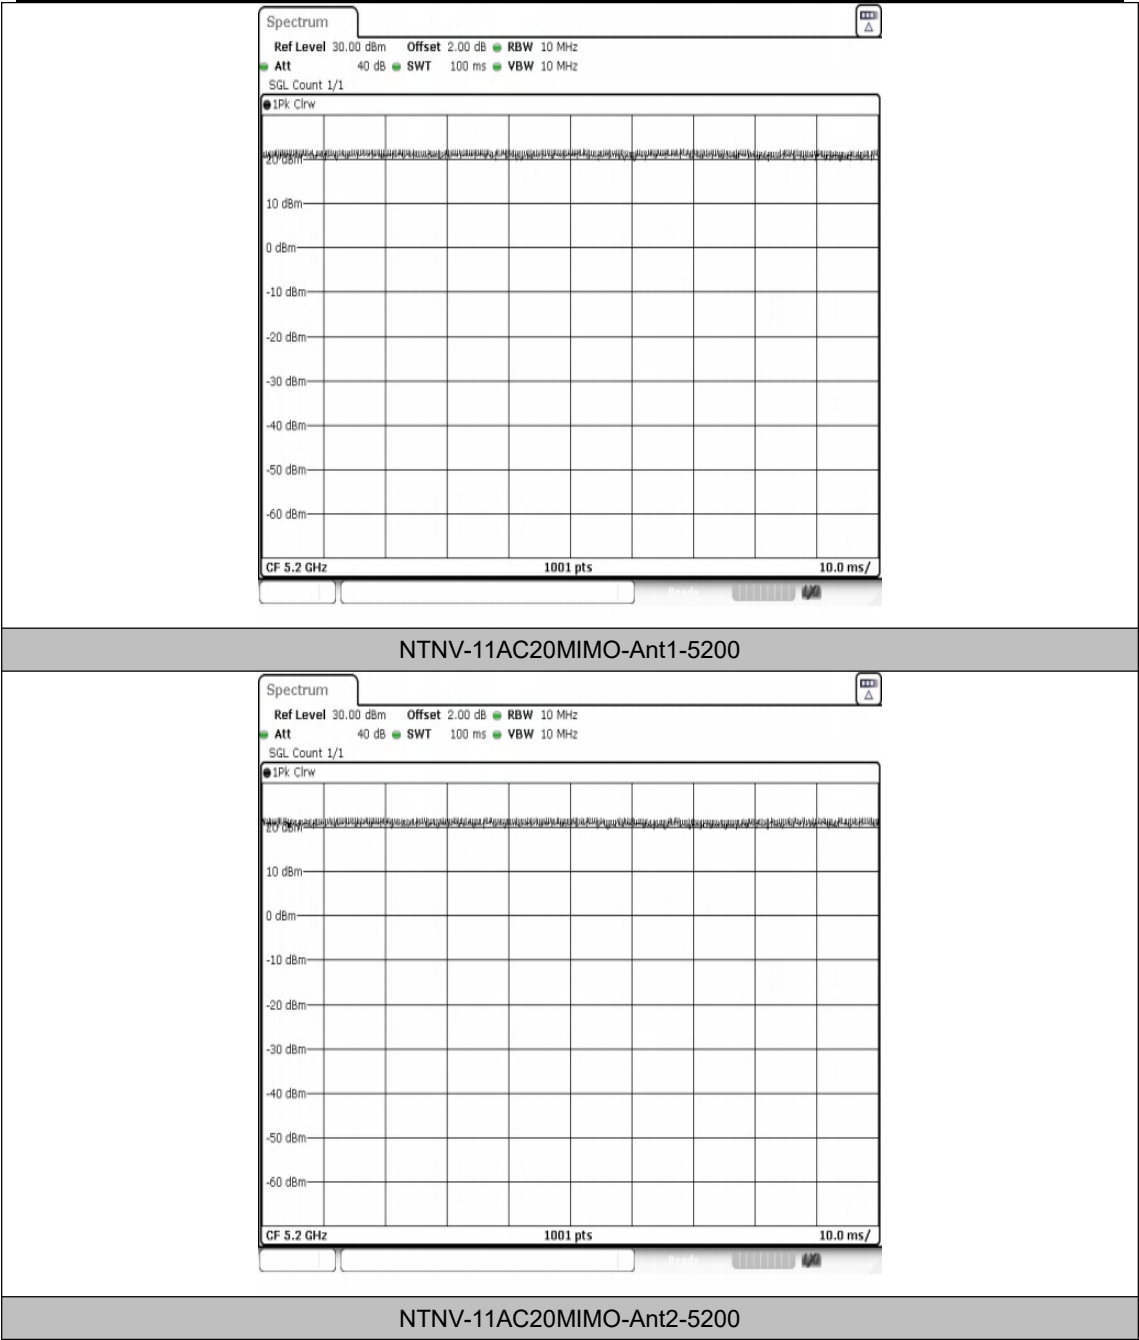


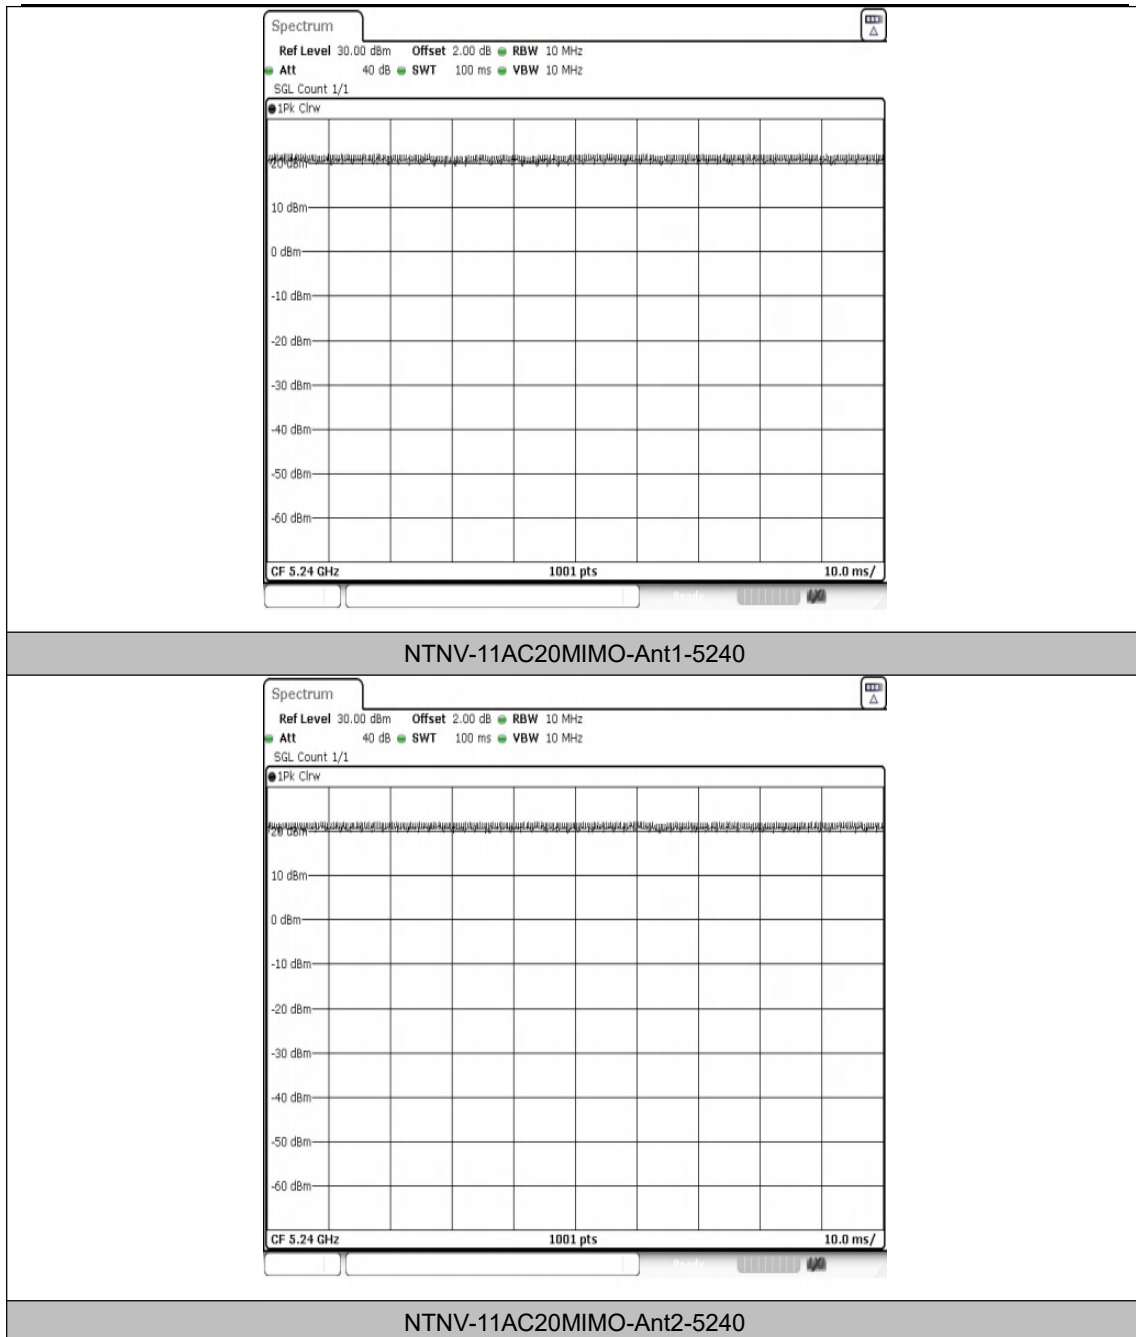

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

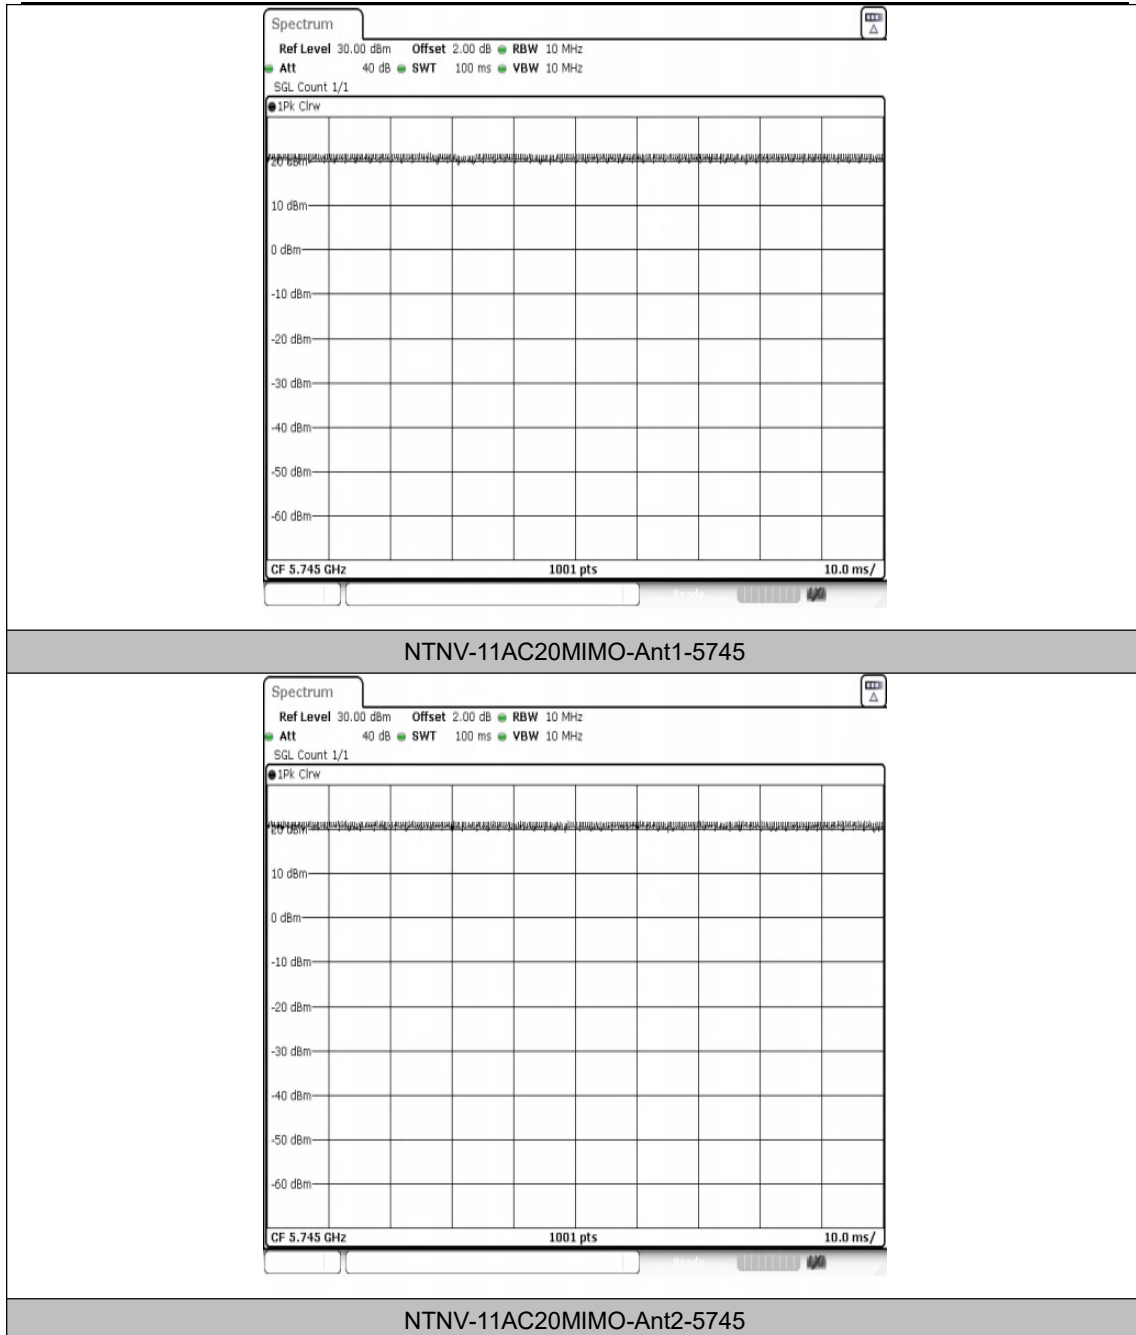


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

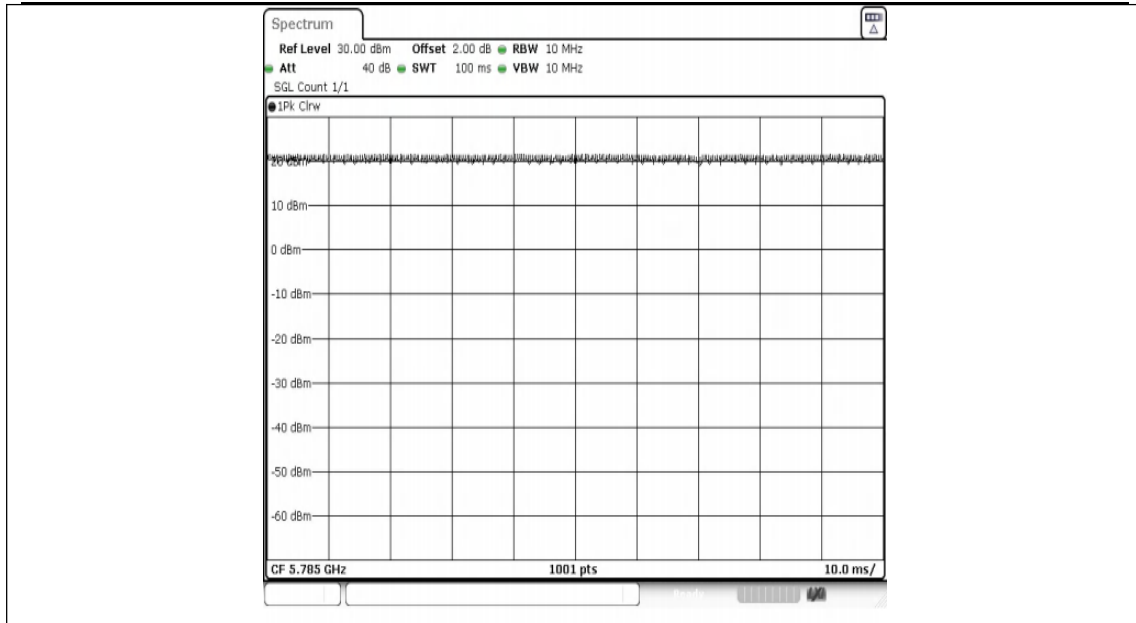

NTNV-11AC20MIMO-Ant1-5785

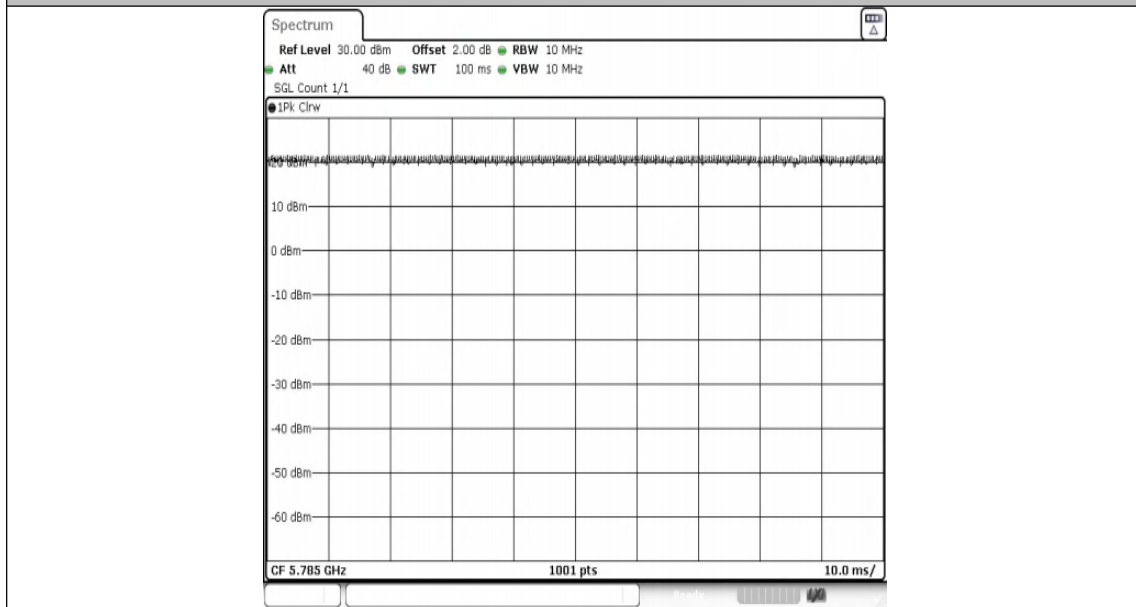

NTNV-11AC20MIMO-Ant2-5785

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com