Duty Cycle NVNT ac40 5190MHz Ant1

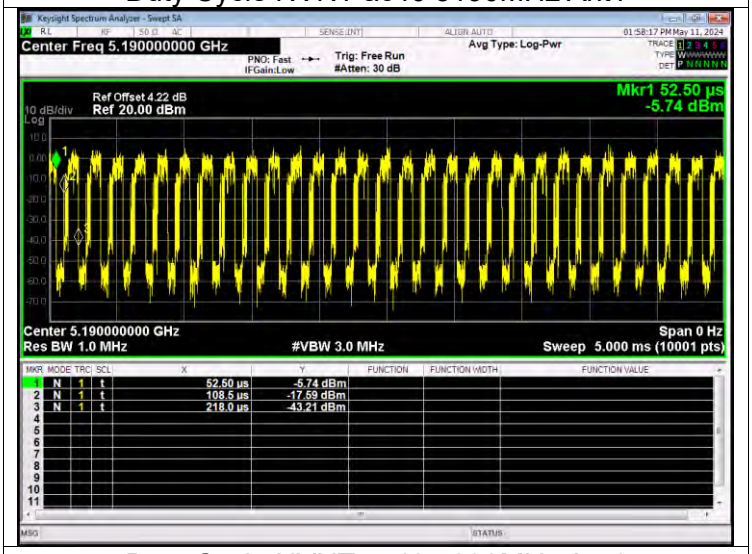

Duty Cycle NVNT ac40 5230MHz Ant1

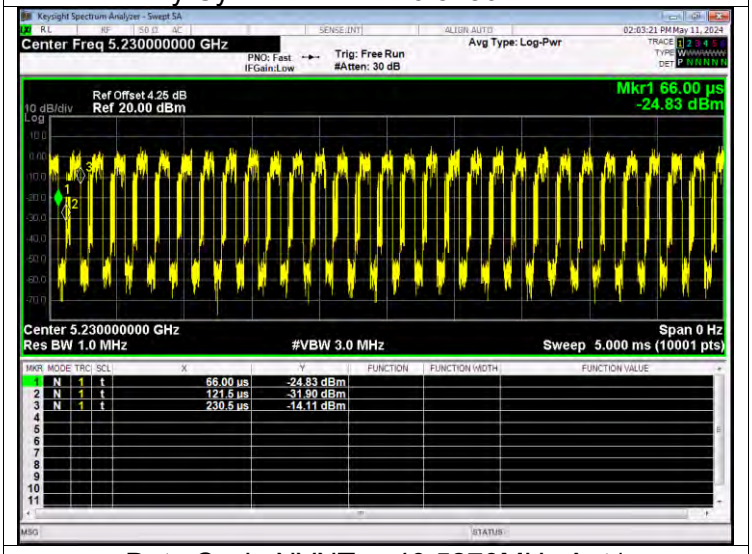

Duty Cycle NVNT ac40 5270MHz Ant1

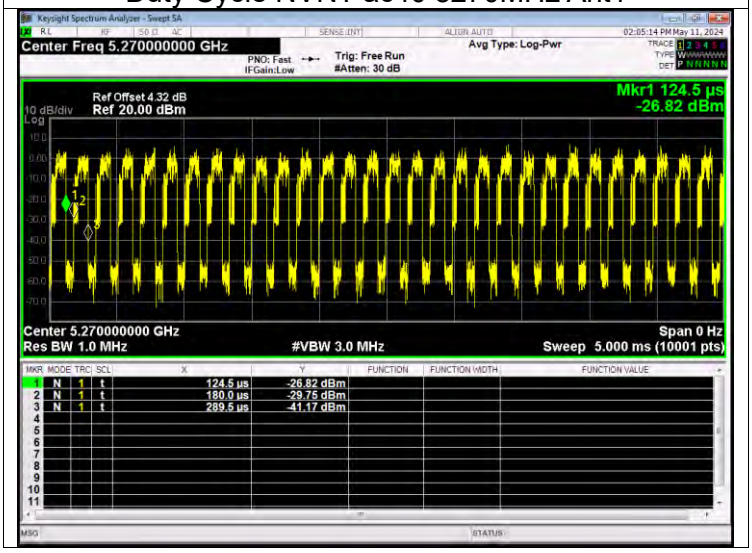

Duty Cycle NVNT ac40 5310MHz Ant1

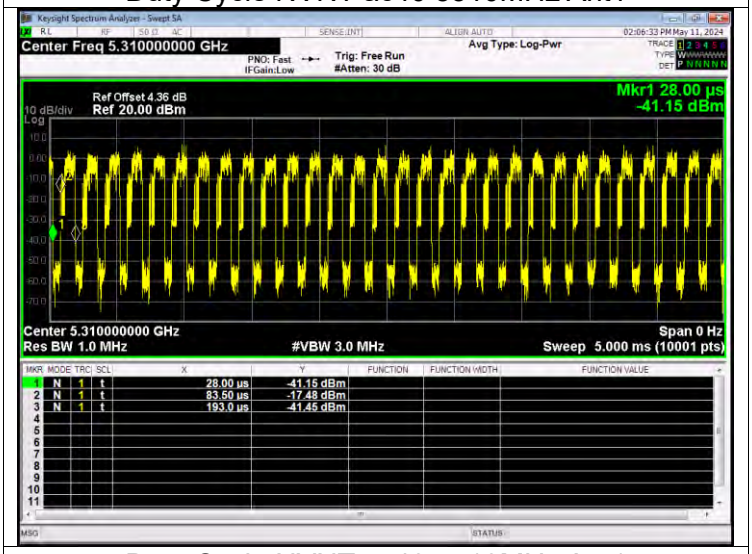

Duty Cycle NVNT ac40 5510MHz Ant1

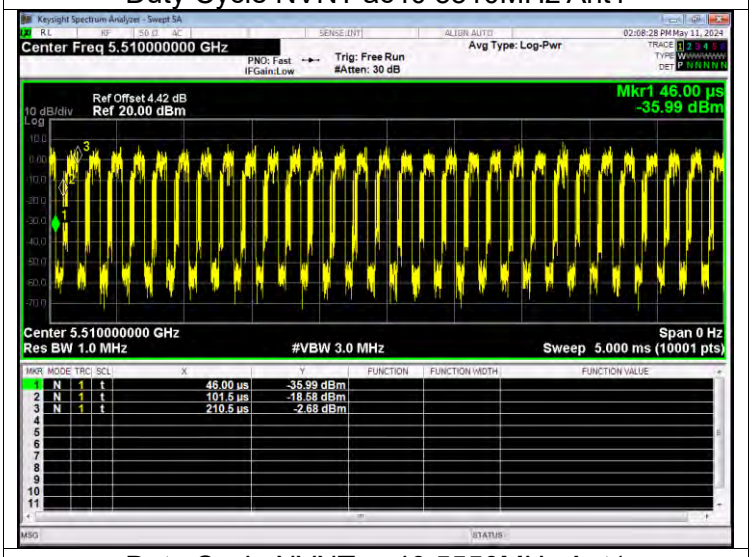

Duty Cycle NVNT ac40 5550MHz Ant1

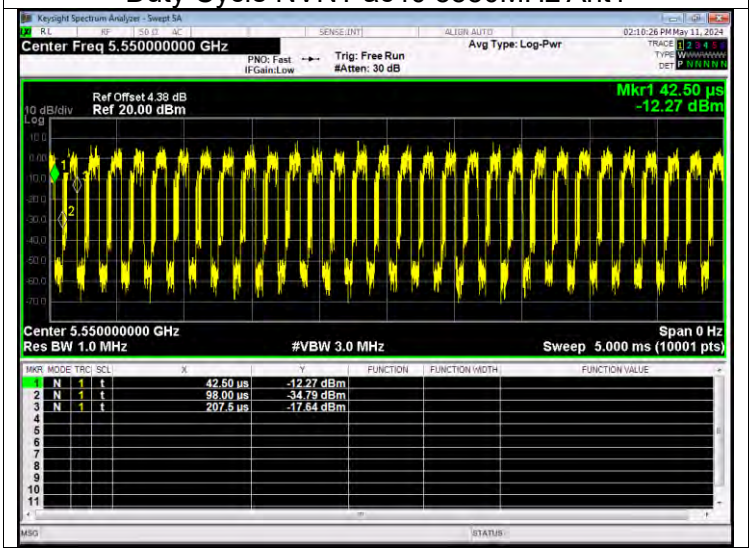

Duty Cycle NVNT ac40 5670MHz Ant1

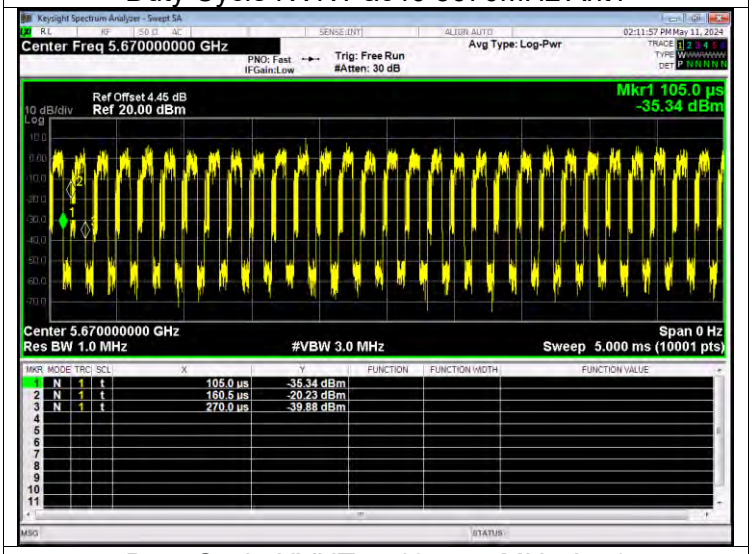

Duty Cycle NVNT ac40 5755MHz Ant1

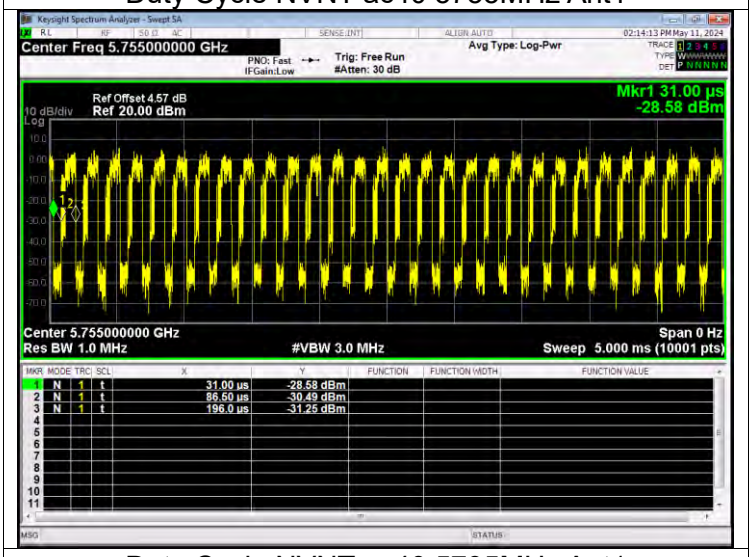

Duty Cycle NVNT ac40 5795MHz Ant1

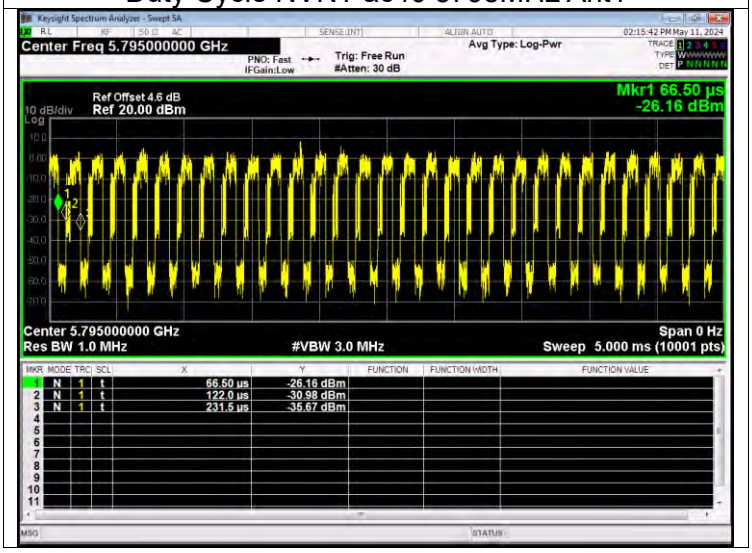

Duty Cycle NVNT ac40 5190MHz Ant2

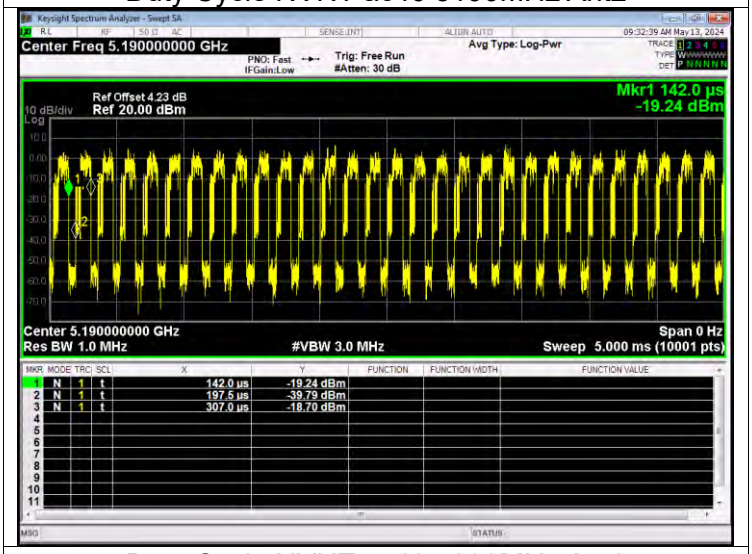

Duty Cycle NVNT ac40 5230MHz Ant2

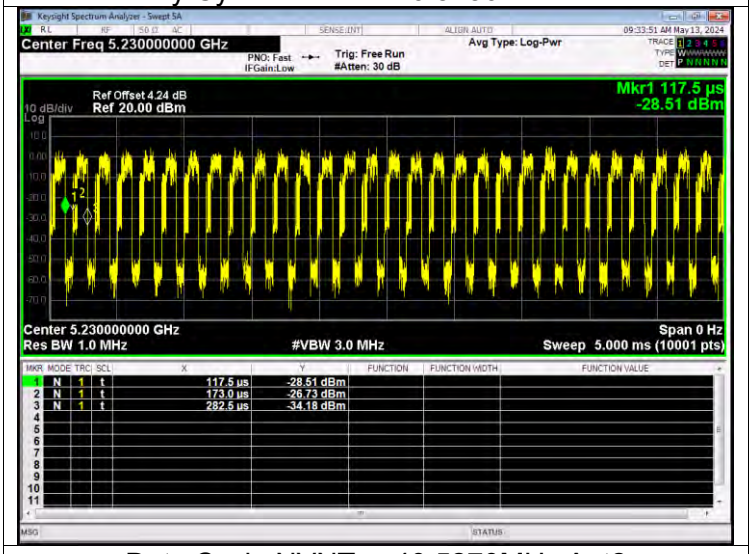

Duty Cycle NVNT ac40 5270MHz Ant2

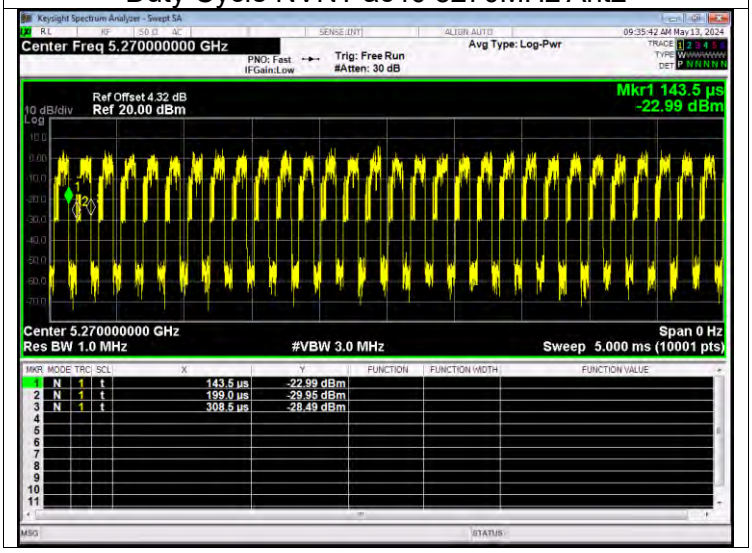

Duty Cycle NVNT ac40 5310MHz Ant2

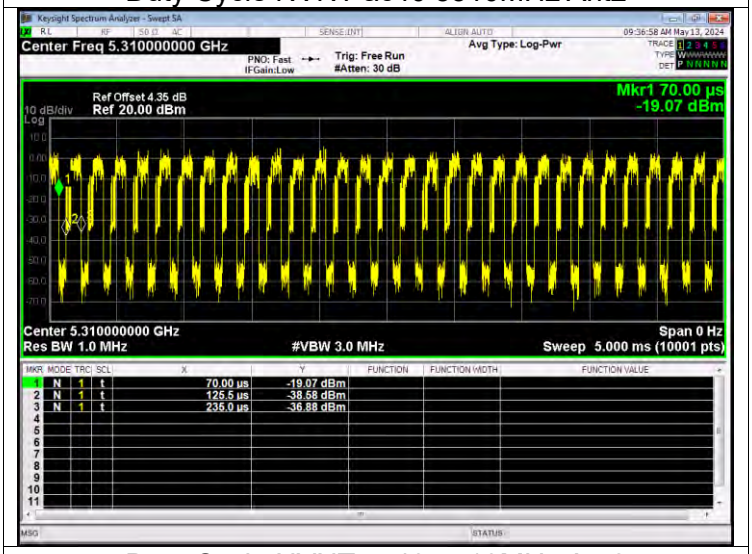

Duty Cycle NVNT ac40 5510MHz Ant2

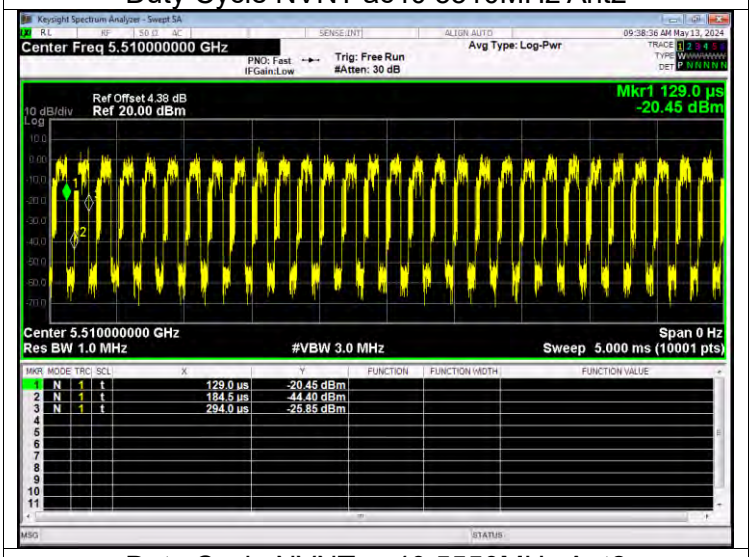

Duty Cycle NVNT ac40 5550MHz Ant2

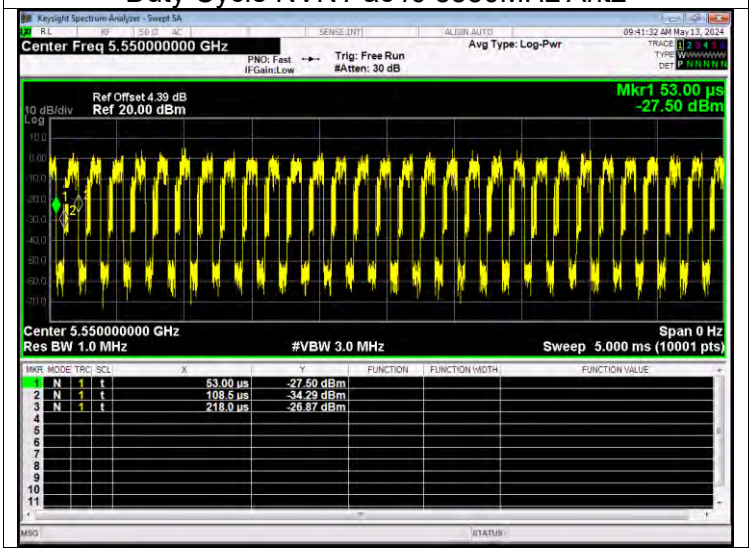

Duty Cycle NVNT ac40 5670MHz Ant2

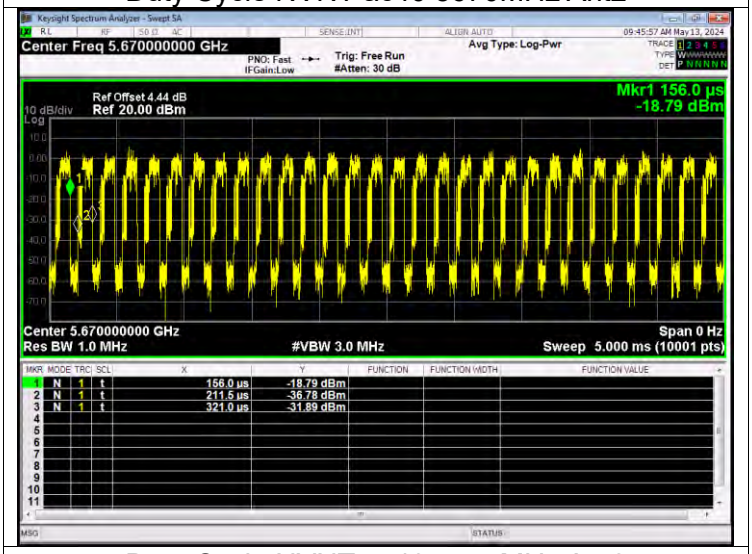

Duty Cycle NVNT ac40 5755MHz Ant2

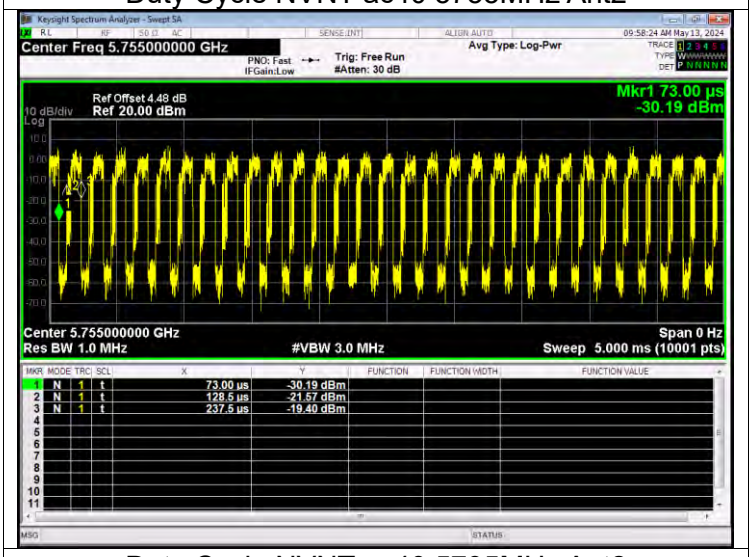

Duty Cycle NVNT ac40 5795MHz Ant2

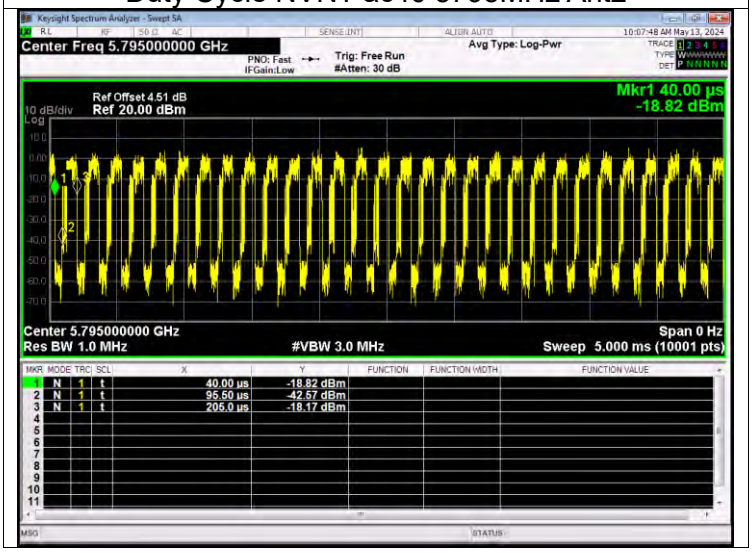

Duty Cycle NVNT ac40 5190MHz Sum

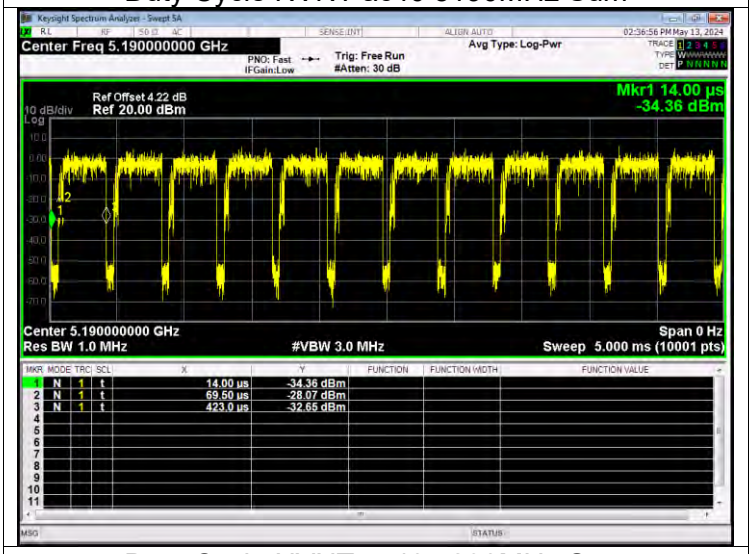

Duty Cycle NVNT ac40 5230MHz Sum

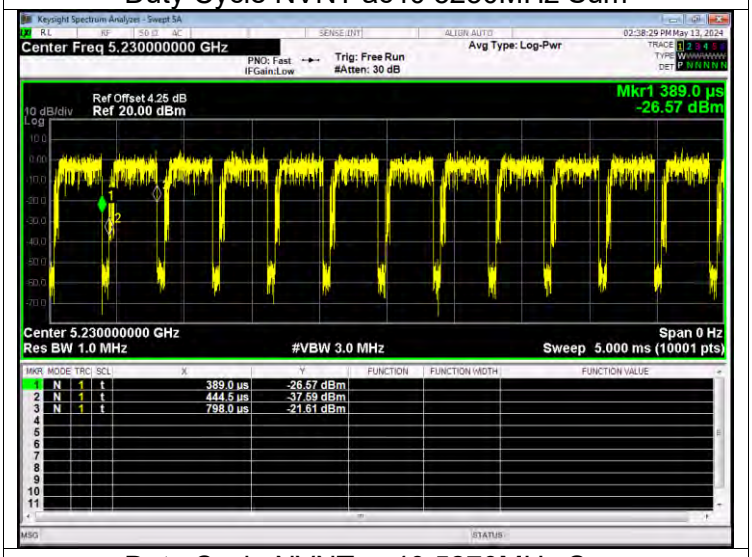

Duty Cycle NVNT ac40 5270MHz Sum

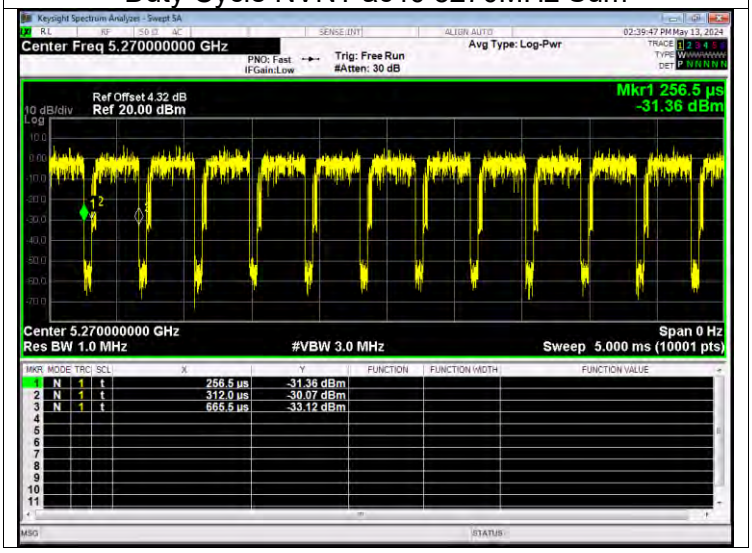

Duty Cycle NVNT ac40 5310MHz Sum

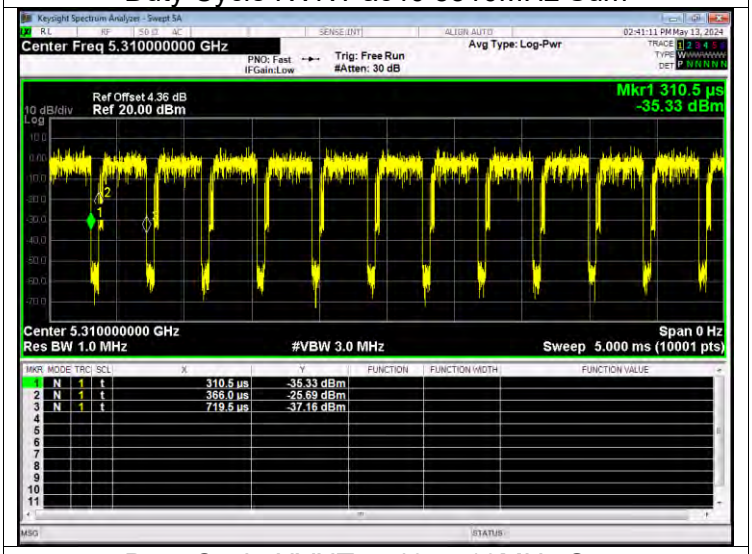

Duty Cycle NVNT ac40 5510MHz Sum

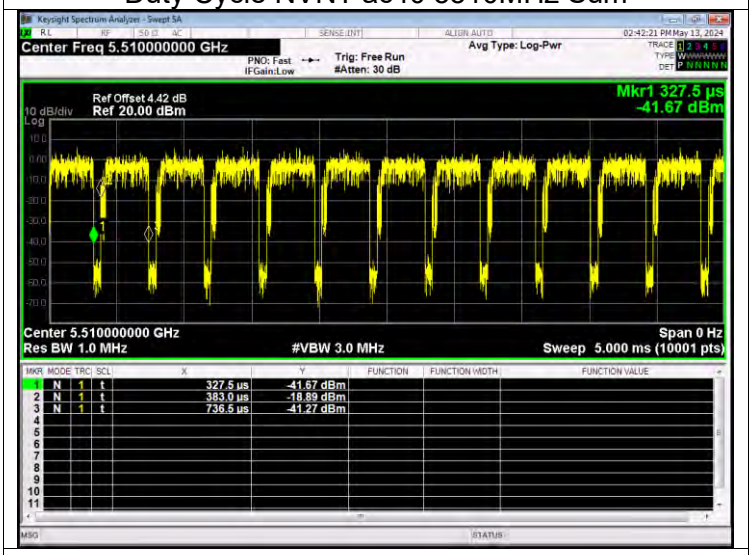

Duty Cycle NVNT ac40 5550MHz Sum

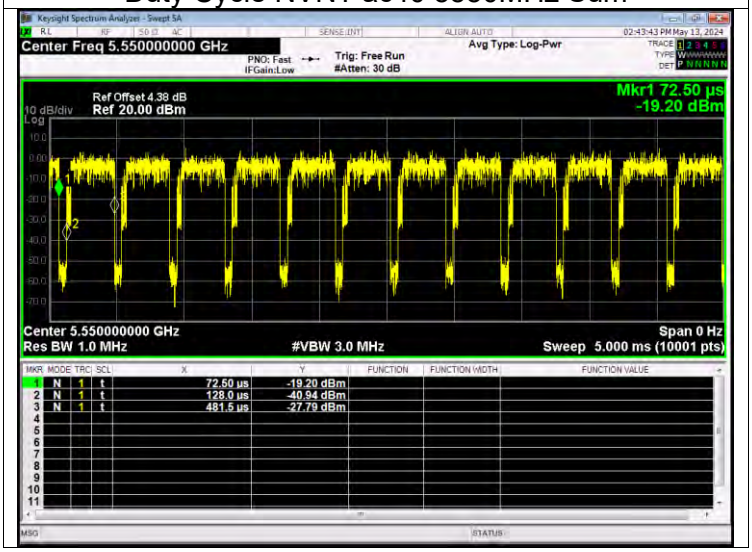

Duty Cycle NVNT ac40 5670MHz Sum

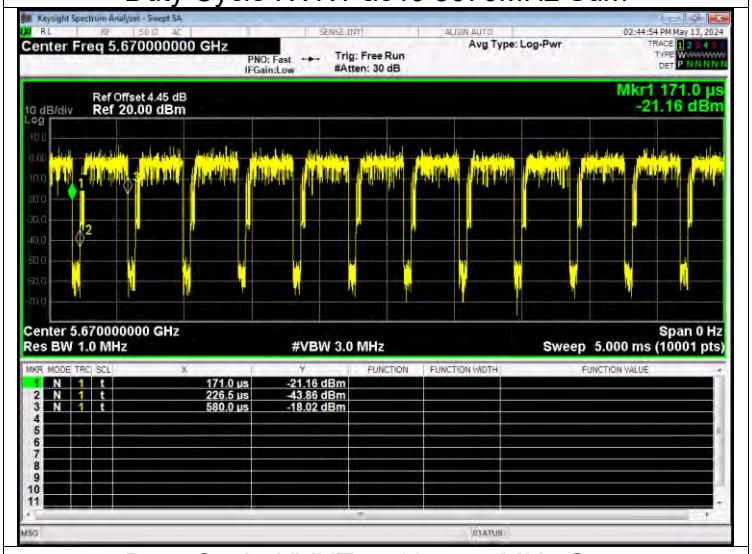

Duty Cycle NVNT ac40 5755MHz Sum

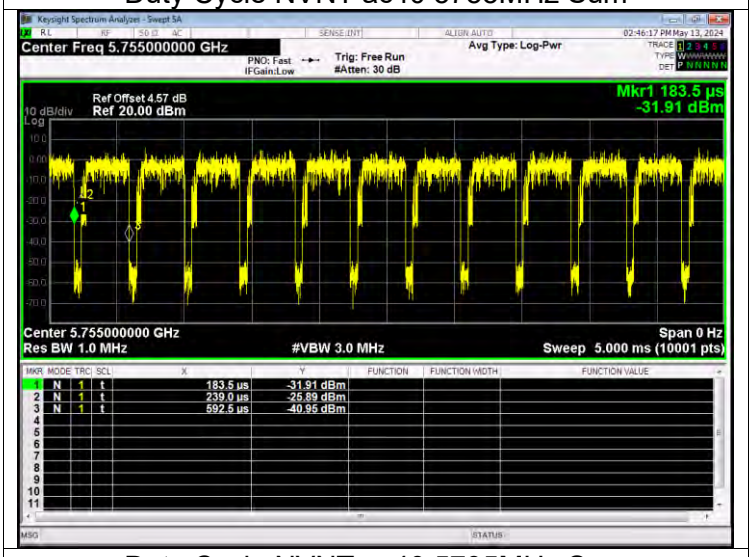

Duty Cycle NVNT ac40 5795MHz Sum

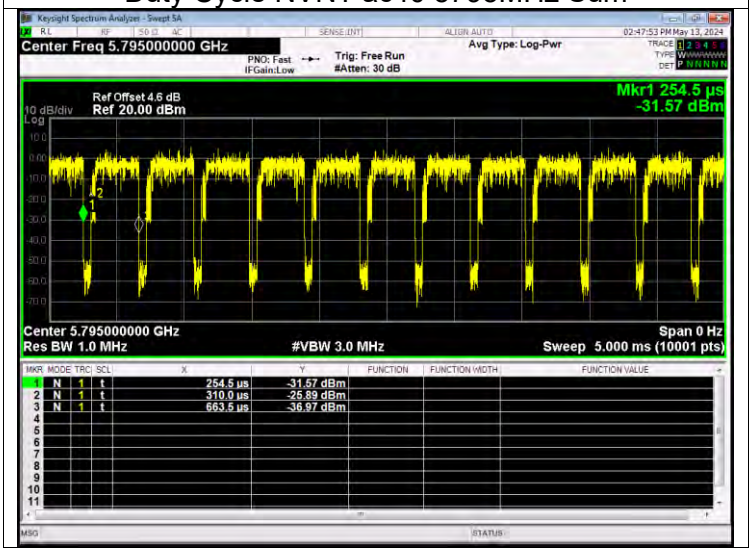

Duty Cycle NVNT ac80 5210MHz Ant1

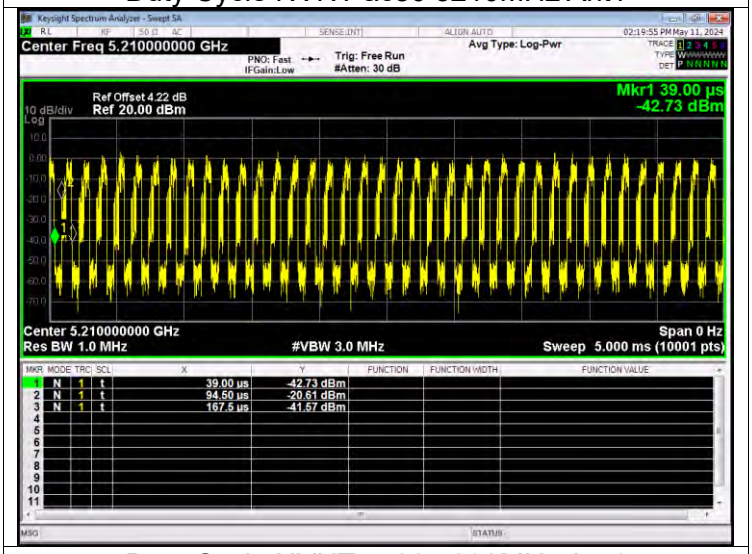

Duty Cycle NVNT ac80 5290MHz Ant1

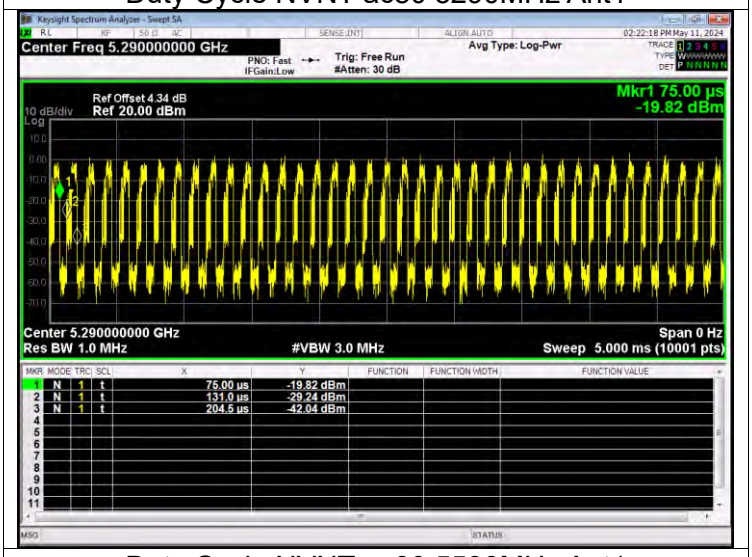

Duty Cycle NVNT ac80 5530MHz Ant1

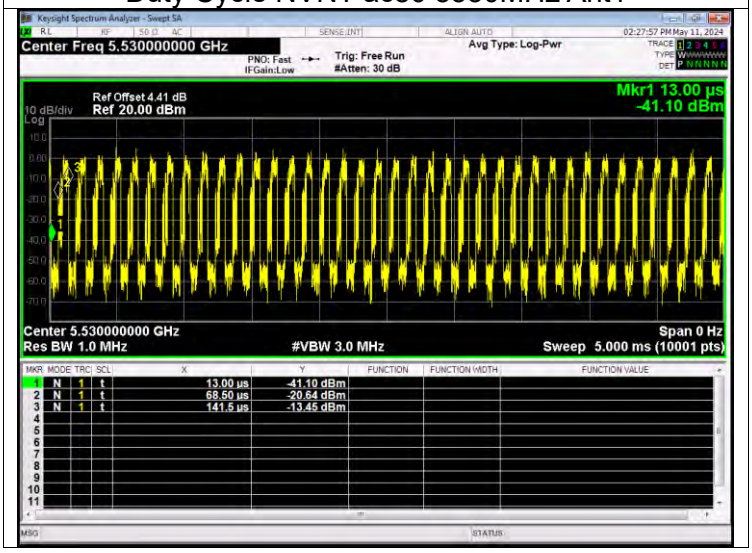

Duty Cycle NVNT ac80 5610MHz Ant1

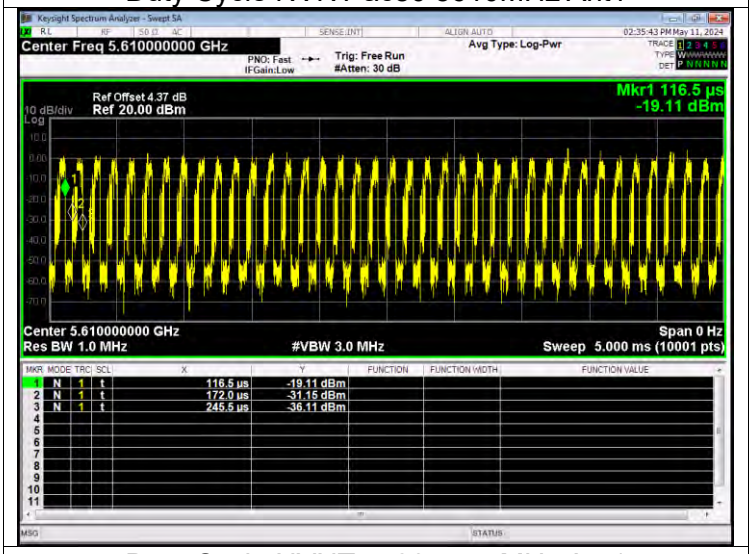

Duty Cycle NVNT ac80 5775MHz Ant1

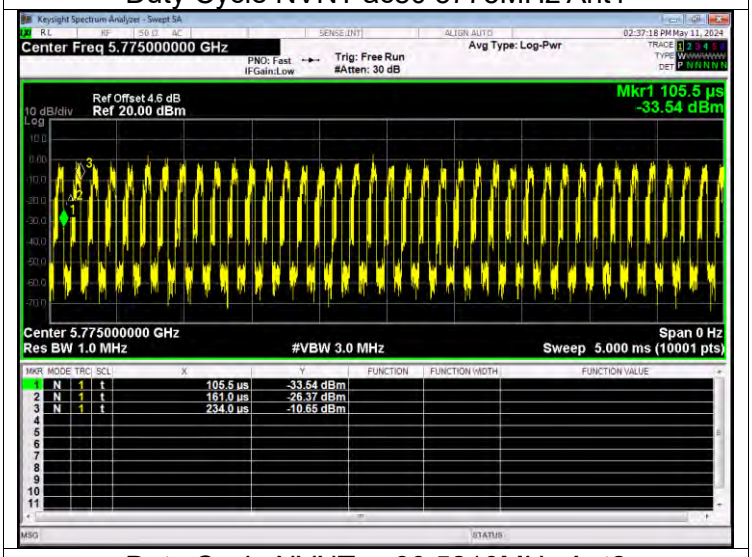

Duty Cycle NVNT ac80 5210MHz Ant2

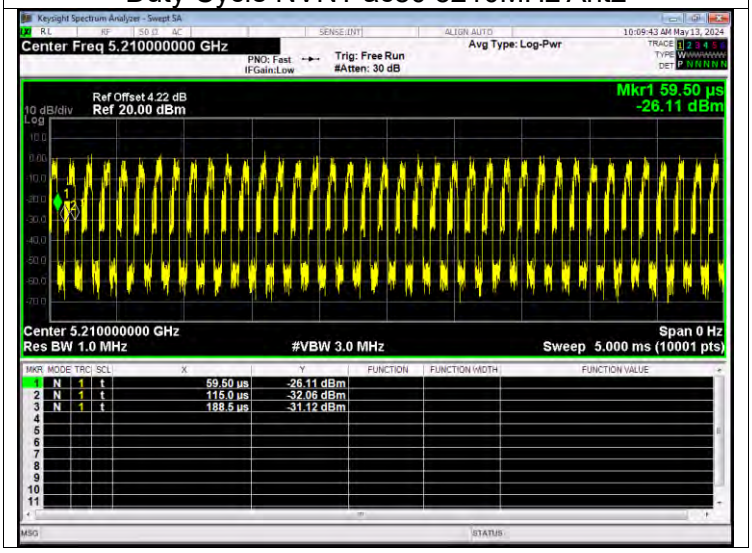

Duty Cycle NVNT ac80 5290MHz Ant2

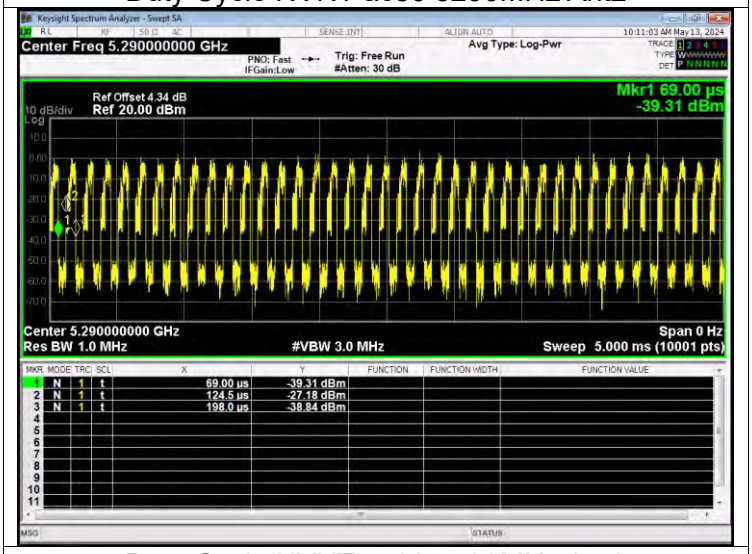

Duty Cycle NVNT ac80 5530MHz Ant2

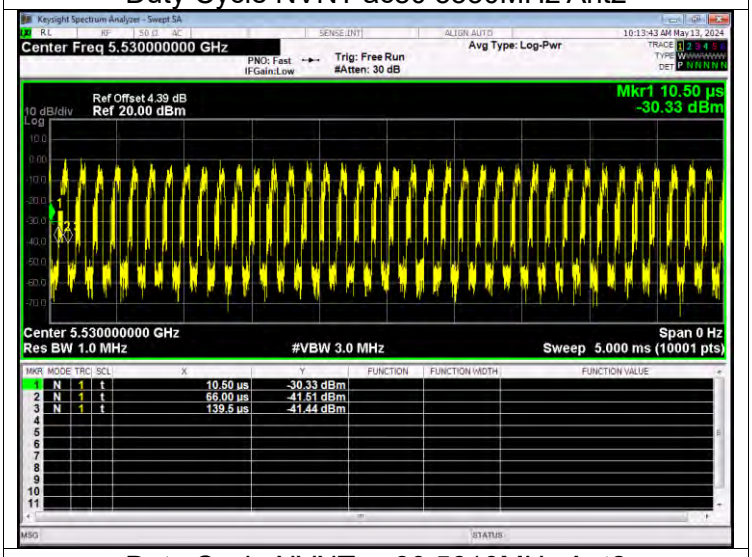

Duty Cycle NVNT ac80 5610MHz Ant2

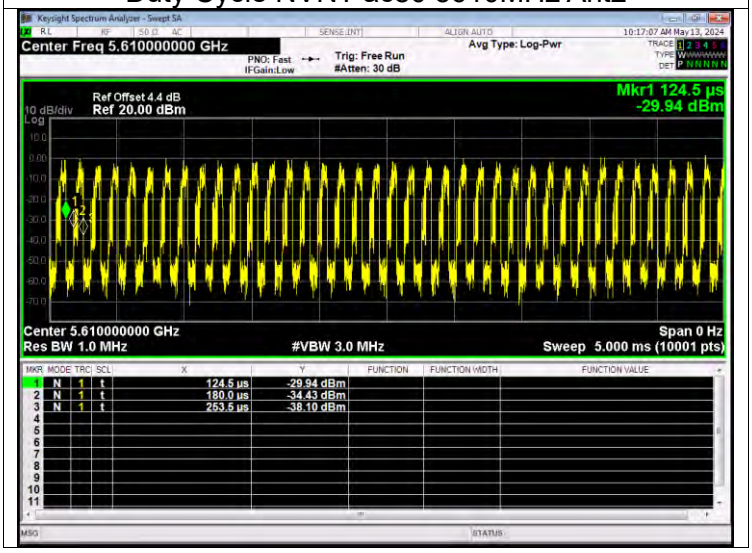

Duty Cycle NVNT ac80 5775MHz Ant2

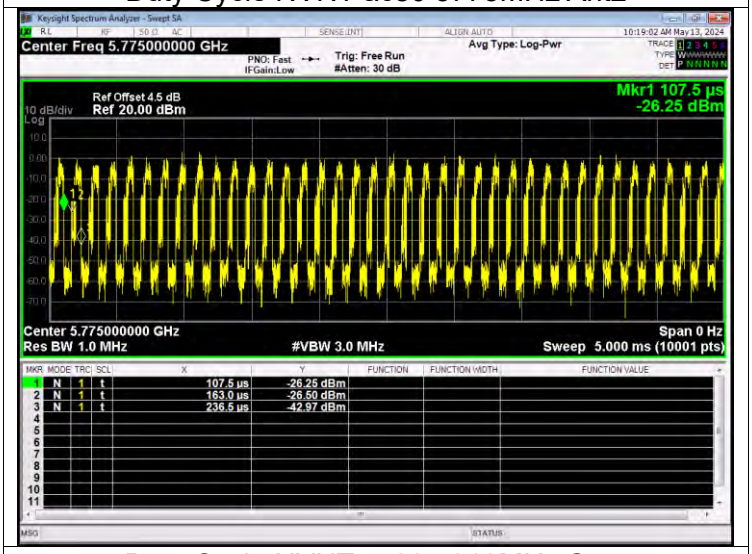

Duty Cycle NVNT ac80 5210MHz Sum

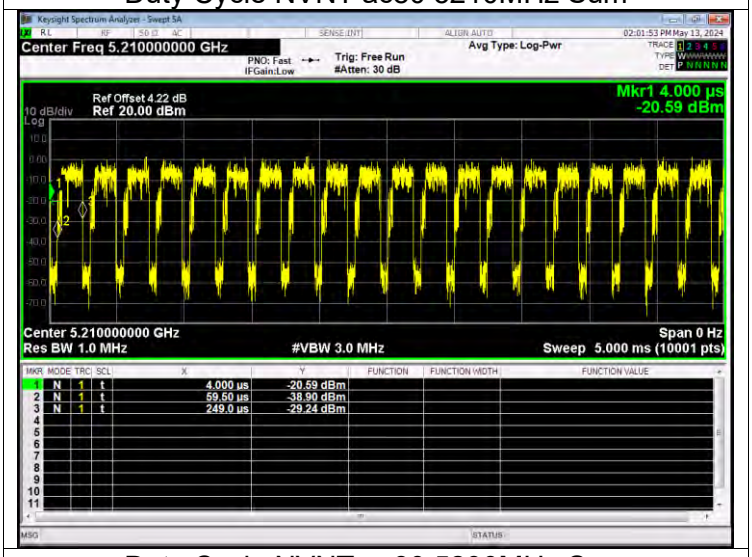

Duty Cycle NVNT ac80 5290MHz Sum

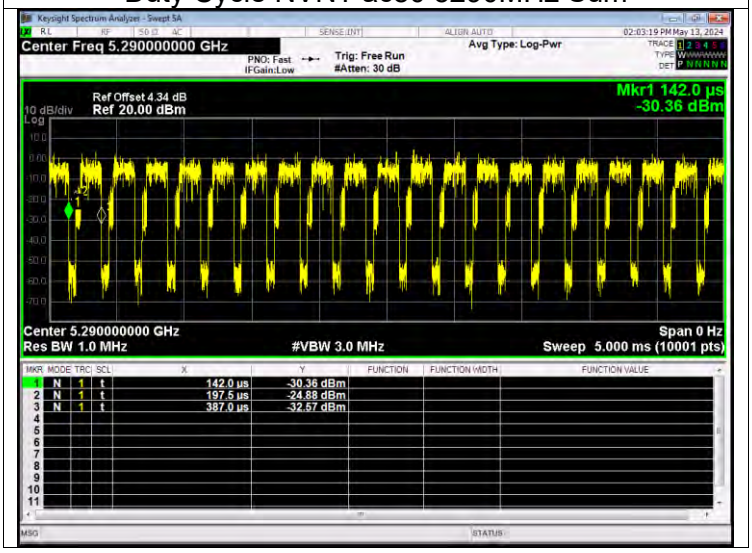

Duty Cycle NVNT ac80 5530MHz Sum

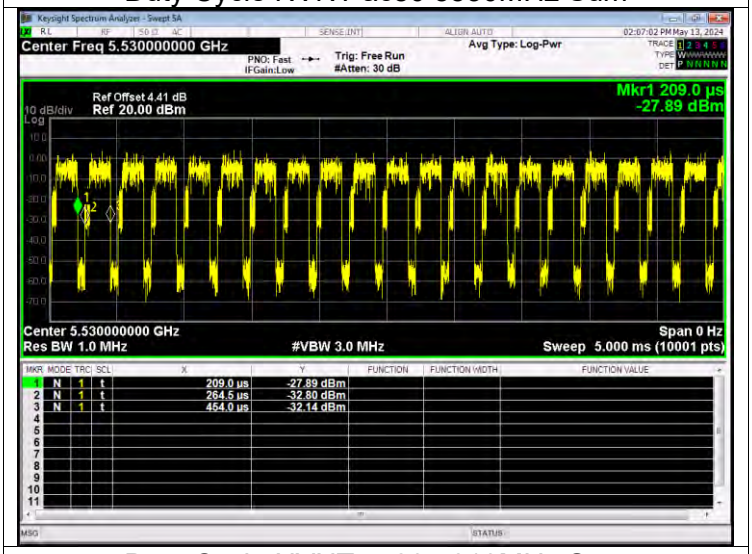

Duty Cycle NVNT ac80 5610MHz Sum

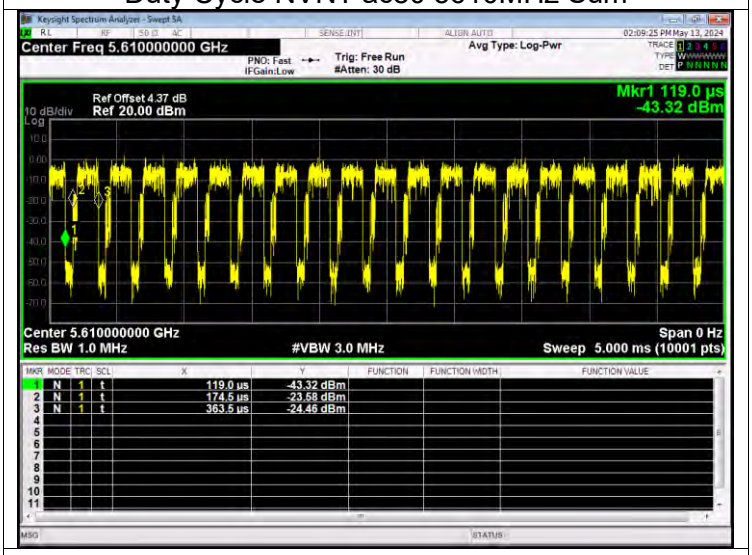

Duty Cycle NVNT ac80 5775MHz Sum

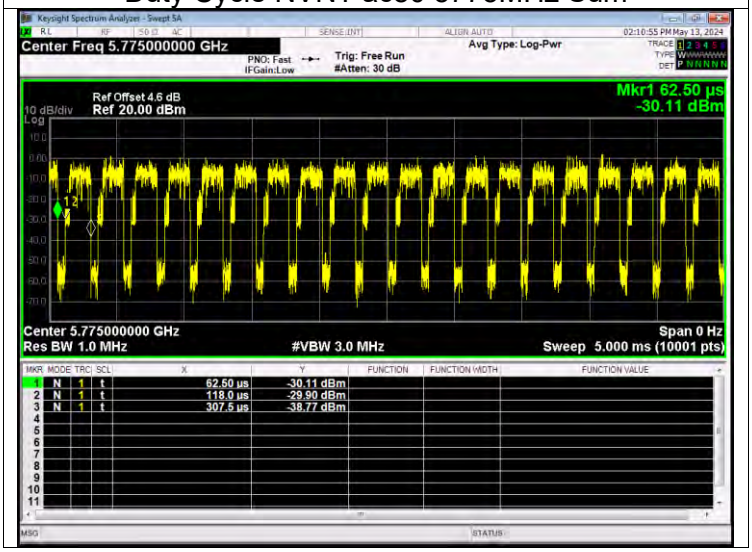

Duty Cycle NVNT ac160 5250MHz Ant1

Duty Cycle NVNT ac160 5570MHz Ant1

Duty Cycle NVNT ac160 5250MHz Ant2

Duty Cycle NVNT ac160 5570MHz Ant2

Duty Cycle NVNT ac160 5250MHz Sum

Duty Cycle NVNT ac160 5570MHz Sum

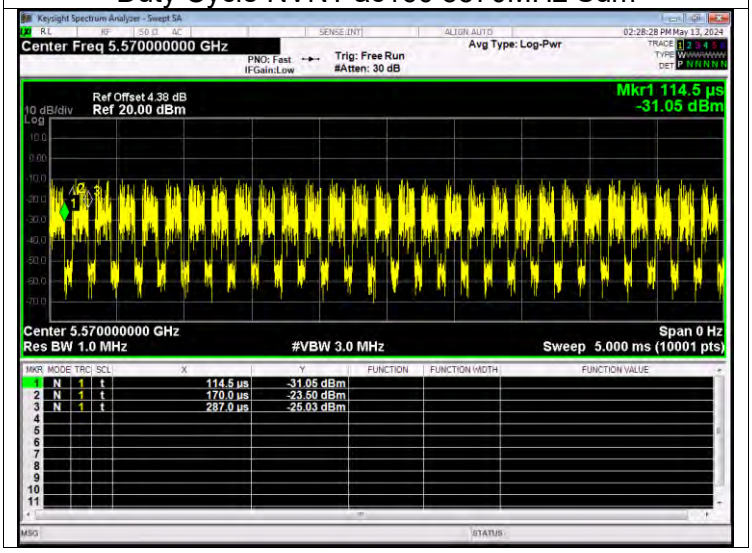

Duty Cycle NVNT ax20 5180MHz Ant1

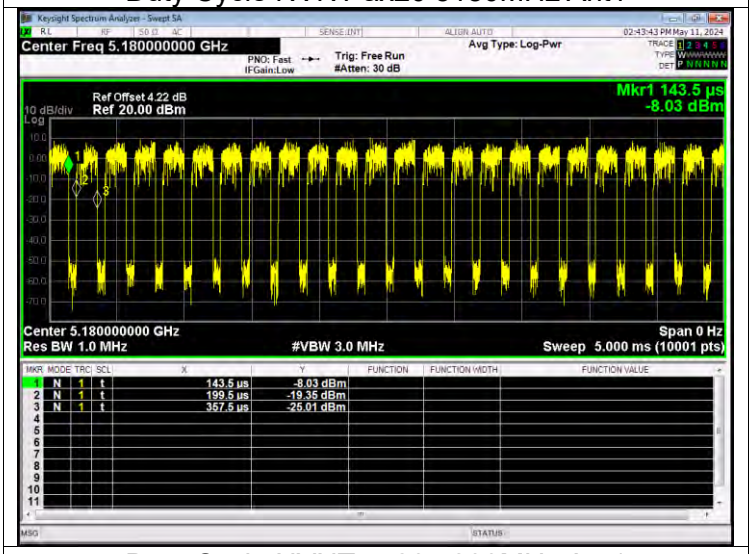

Duty Cycle NVNT ax20 5200MHz Ant1

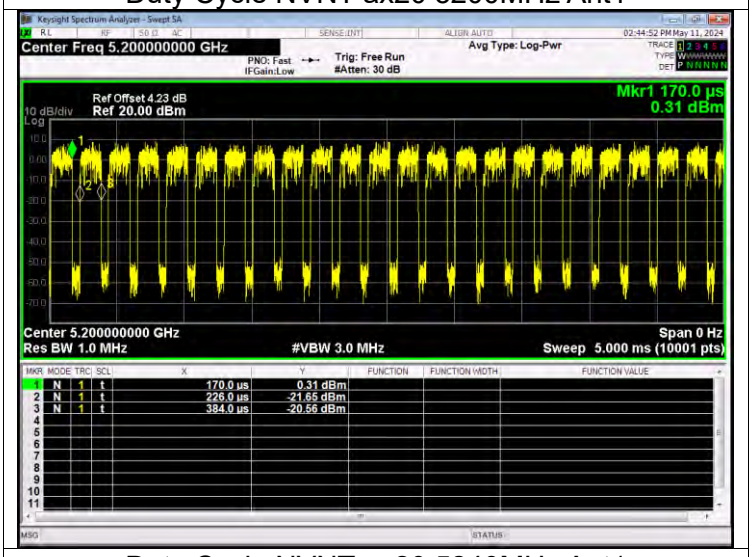

Duty Cycle NVNT ax20 5240MHz Ant1

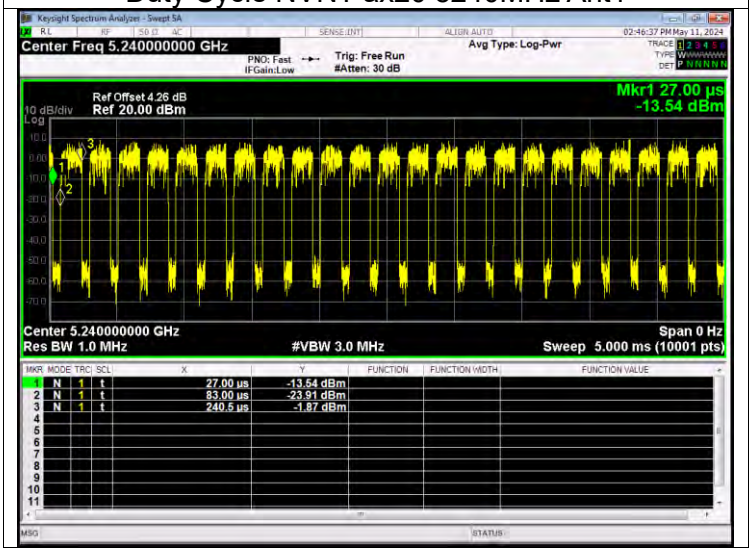

Duty Cycle NVNT ax20 5260MHz Ant1

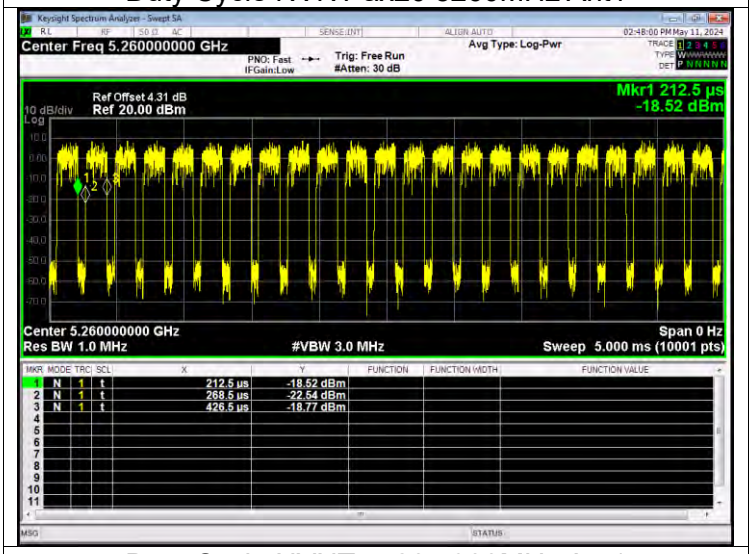

Duty Cycle NVNT ax20 5300MHz Ant1

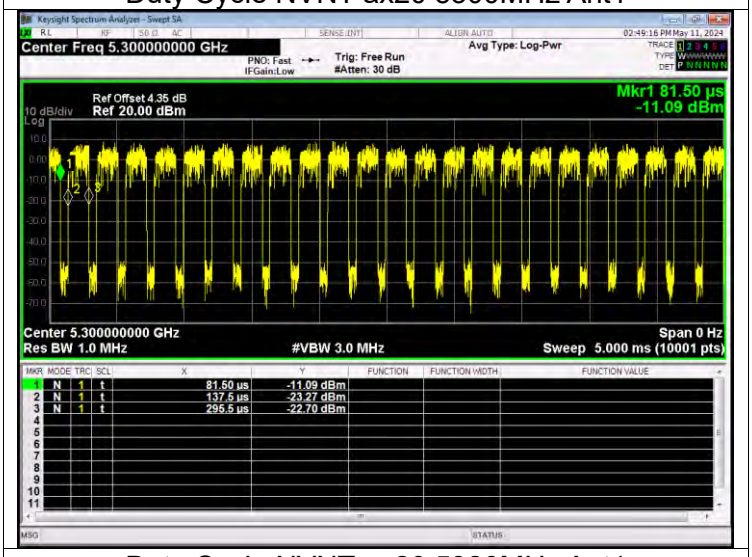

Duty Cycle NVNT ax20 5320MHz Ant1

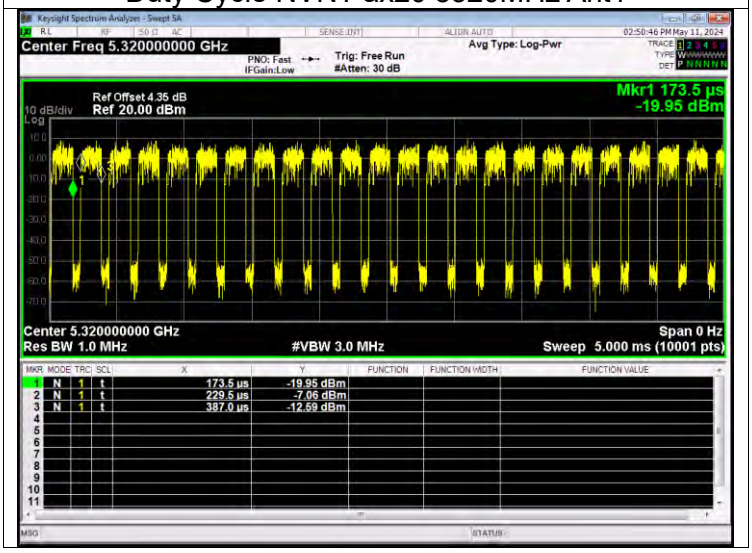

Duty Cycle NVNT ax20 5500MHz Ant1

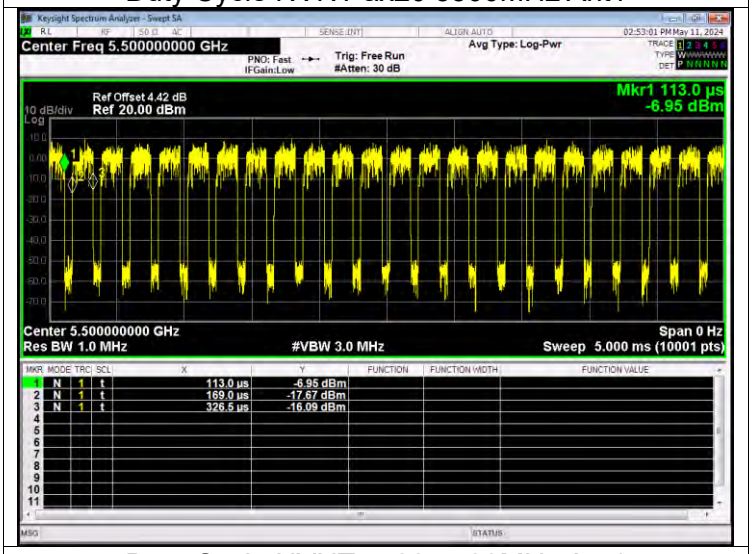

Duty Cycle NVNT ax20 5580MHz Ant1

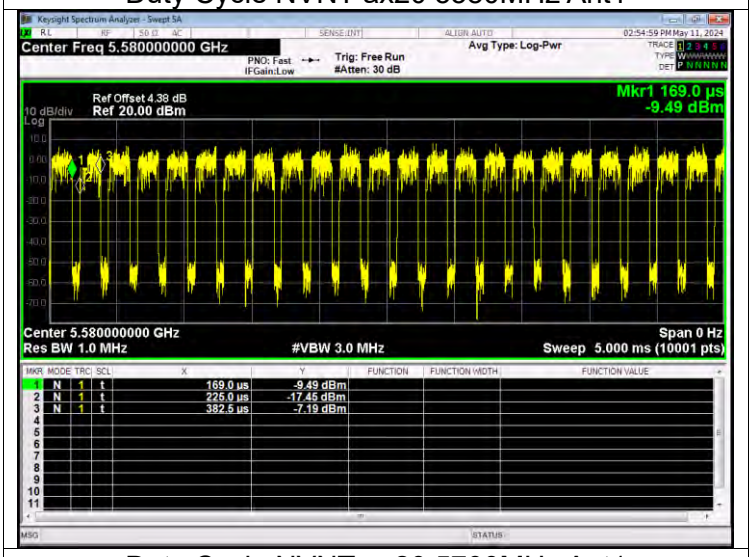

Duty Cycle NVNT ax20 5700MHz Ant1

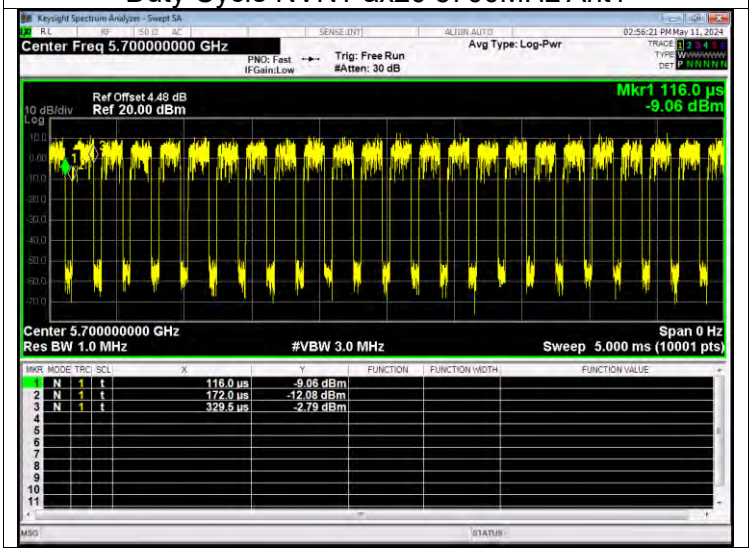

Duty Cycle NVNT ax20 5745MHz Ant1

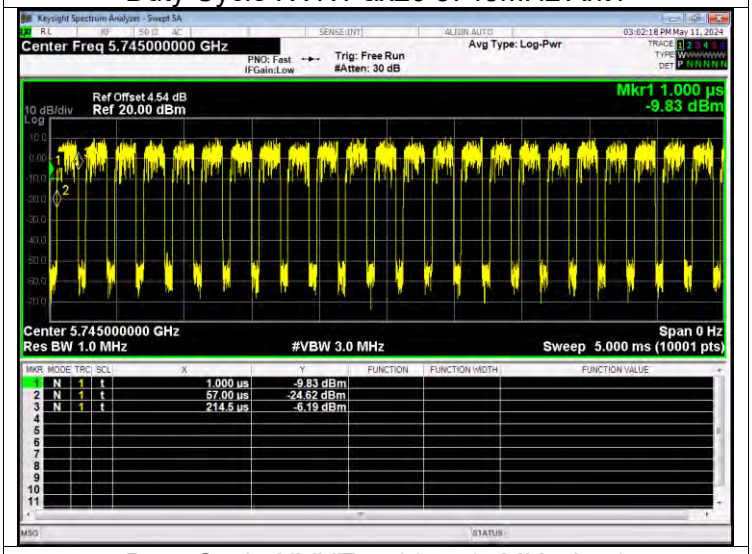

Duty Cycle NVNT ax20 5785MHz Ant1

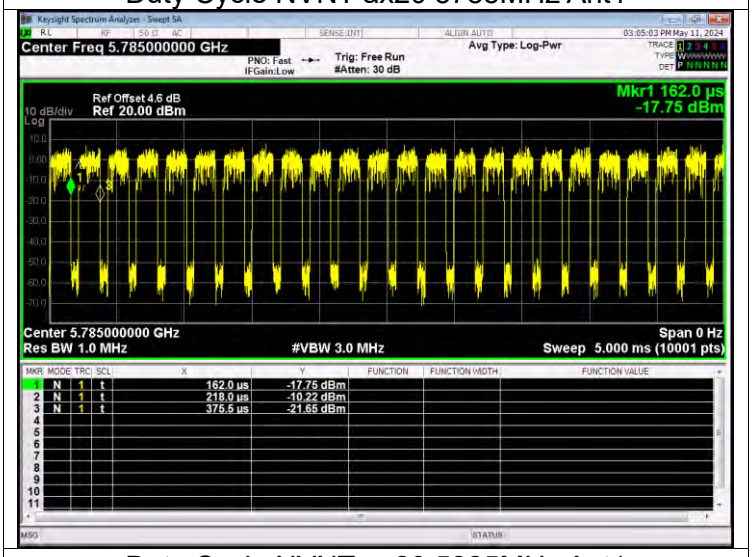

Duty Cycle NVNT ax20 5825MHz Ant1

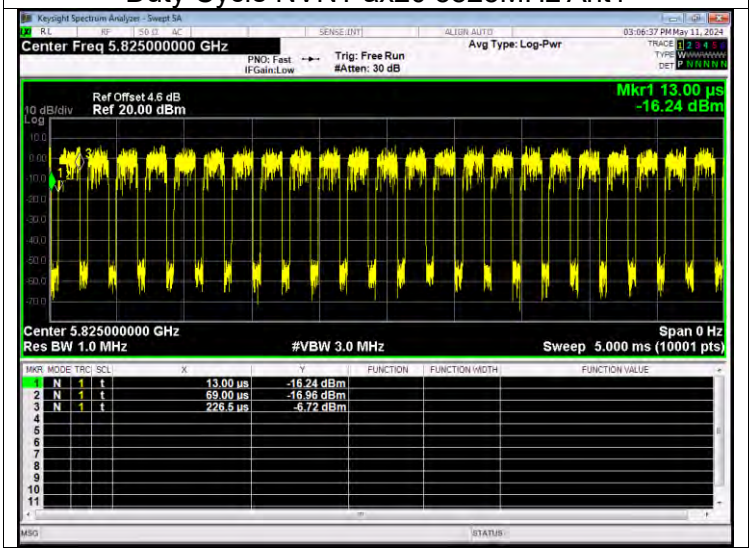

Duty Cycle NVNT ax20 5180MHz Ant2

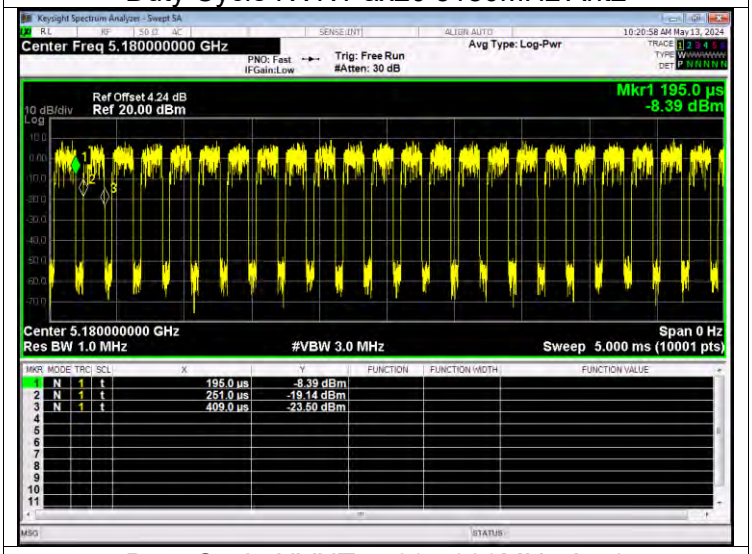

Duty Cycle NVNT ax20 5200MHz Ant2

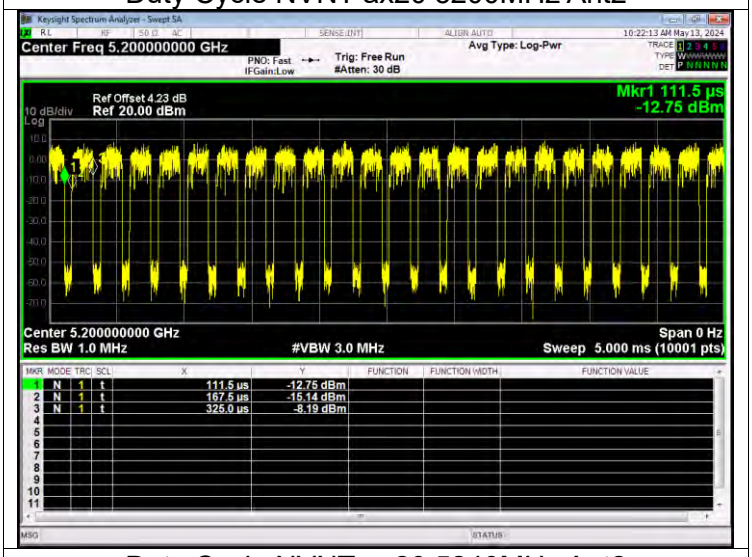

Duty Cycle NVNT ax20 5240MHz Ant2

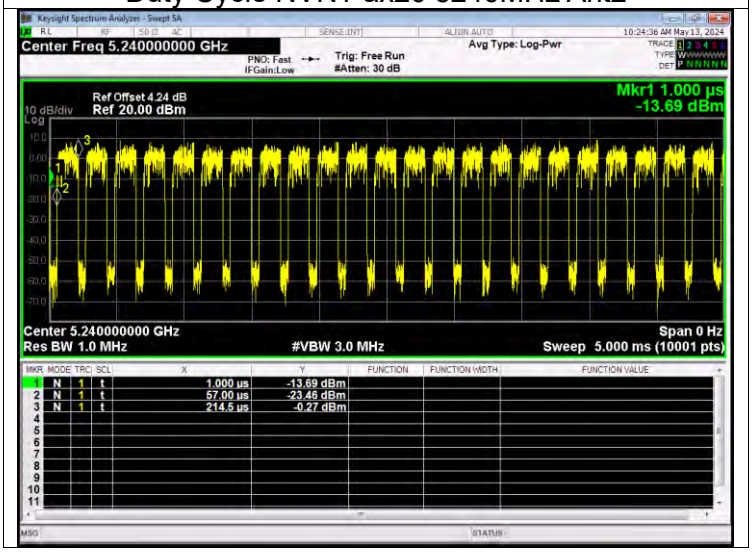

Duty Cycle NVNT ax20 5260MHz Ant2

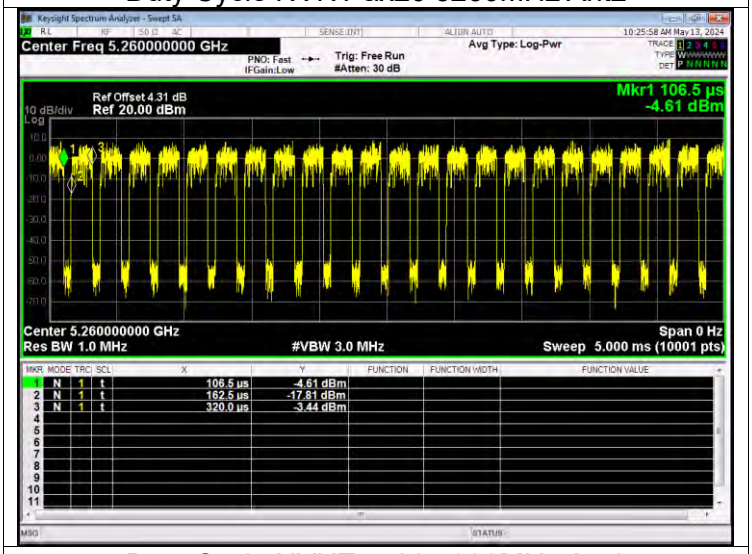

Duty Cycle NVNT ax20 5300MHz Ant2

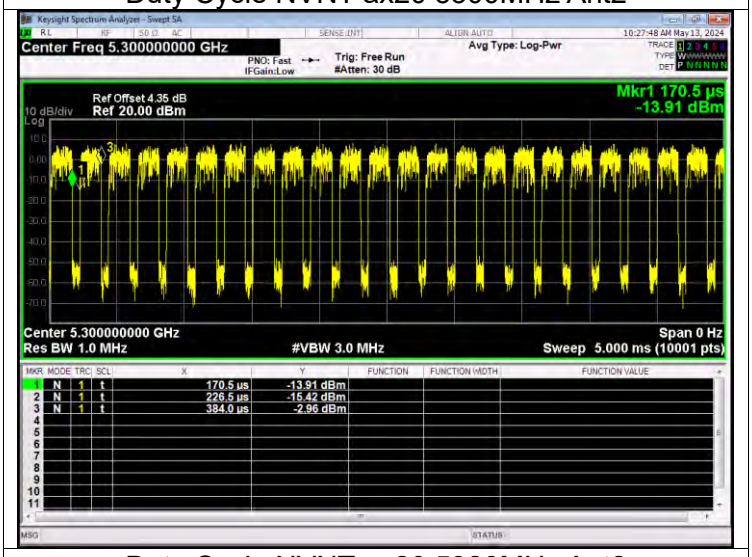

Duty Cycle NVNT ax20 5320MHz Ant2

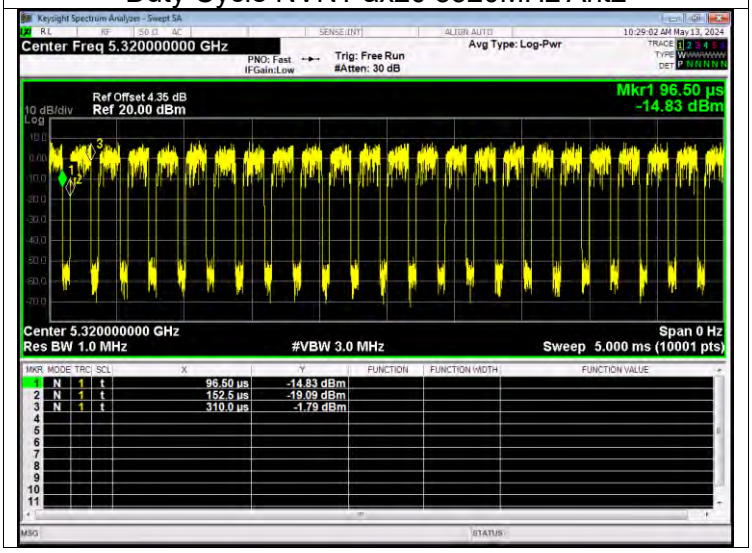

Duty Cycle NVNT ax20 5500MHz Ant2

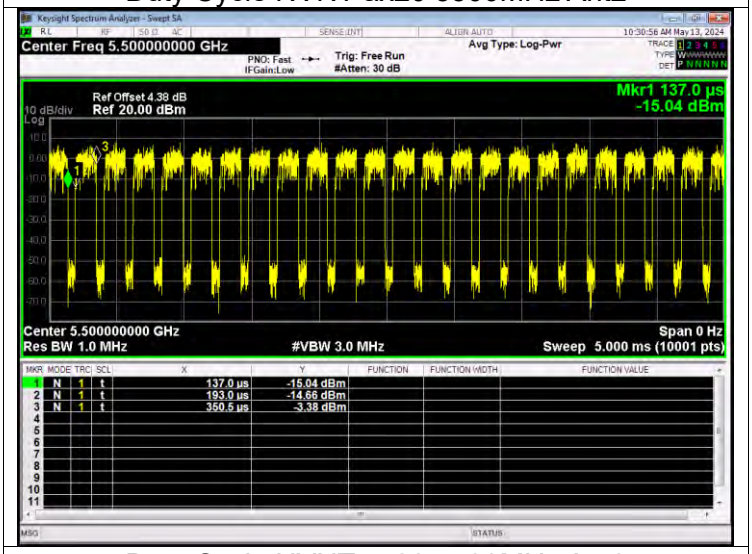

Duty Cycle NVNT ax20 5580MHz Ant2

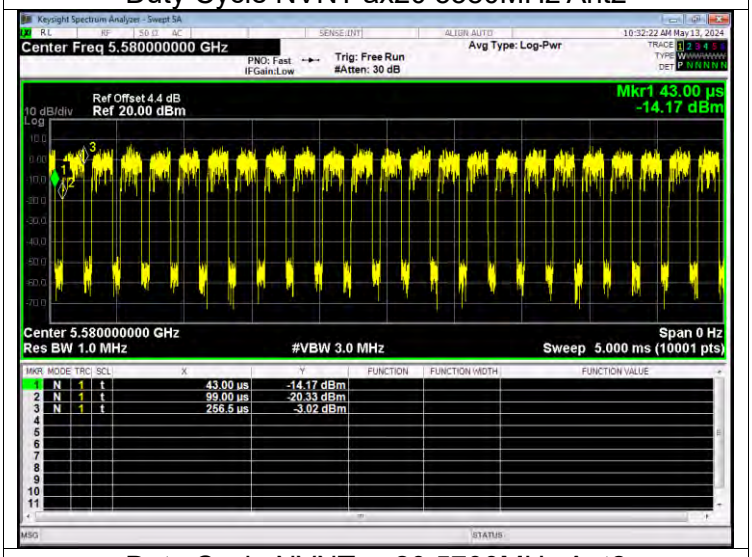

Duty Cycle NVNT ax20 5700MHz Ant2

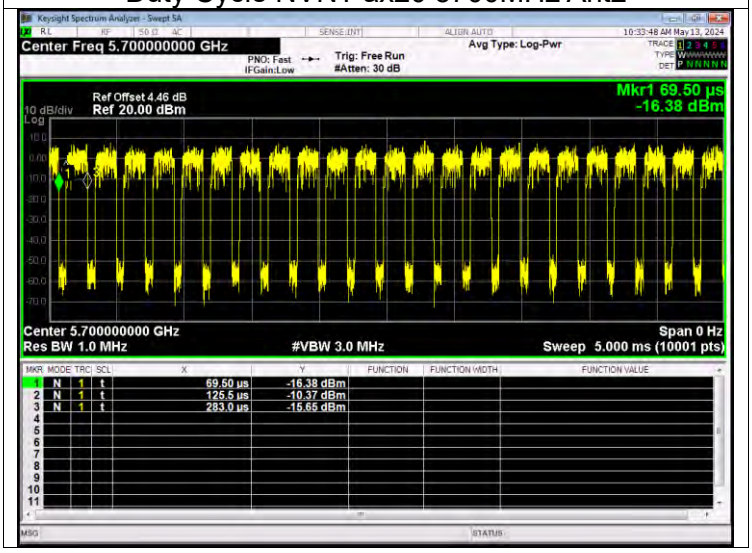

Duty Cycle NVNT ax20 5745MHz Ant2

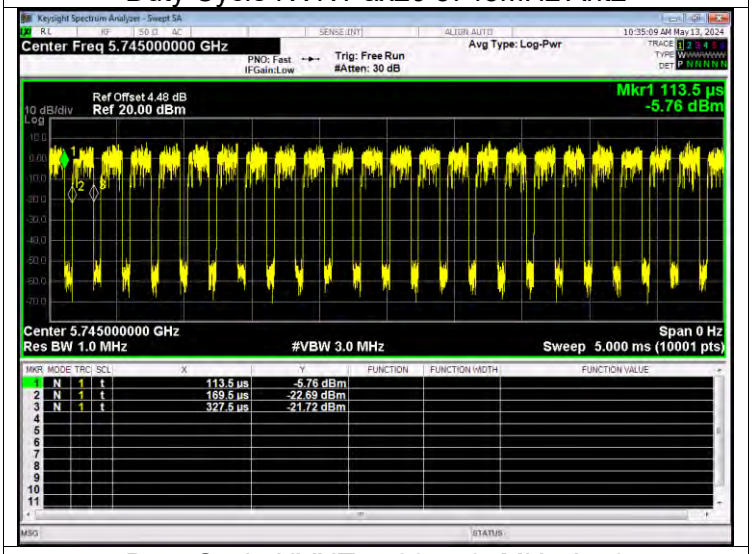

Duty Cycle NVNT ax20 5785MHz Ant2

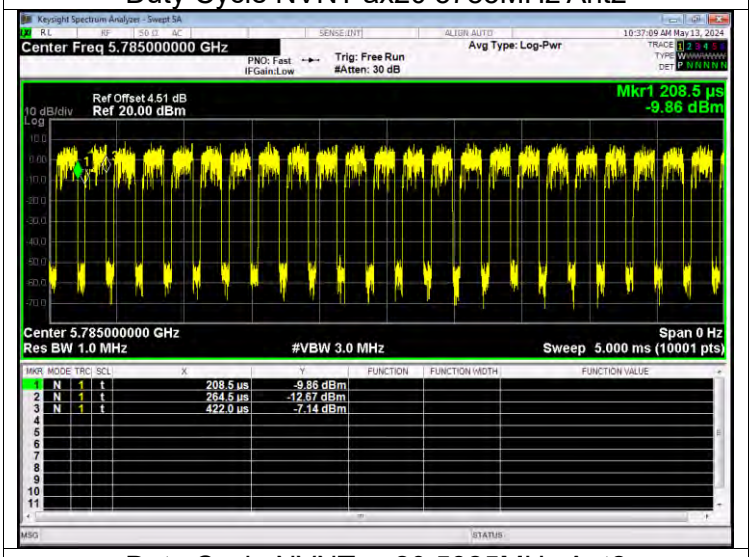

Duty Cycle NVNT ax20 5825MHz Ant2

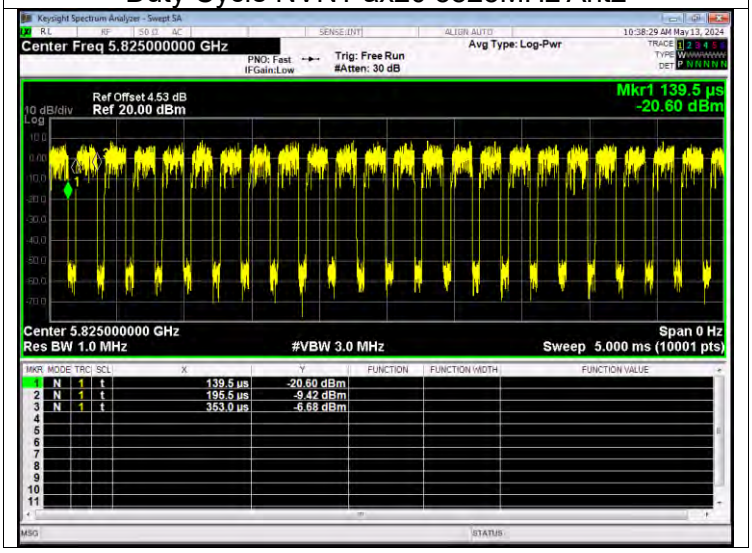

Duty Cycle NVNT ax20 5180MHz Sum

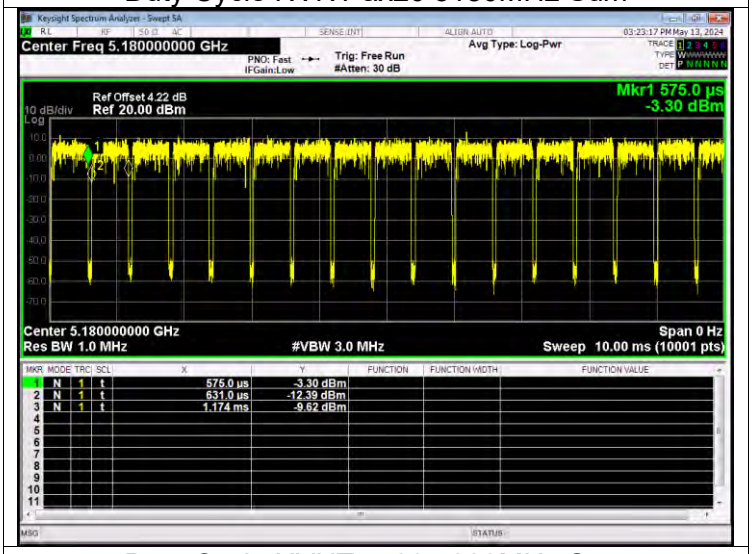

Duty Cycle NVNT ax20 5200MHz Sum

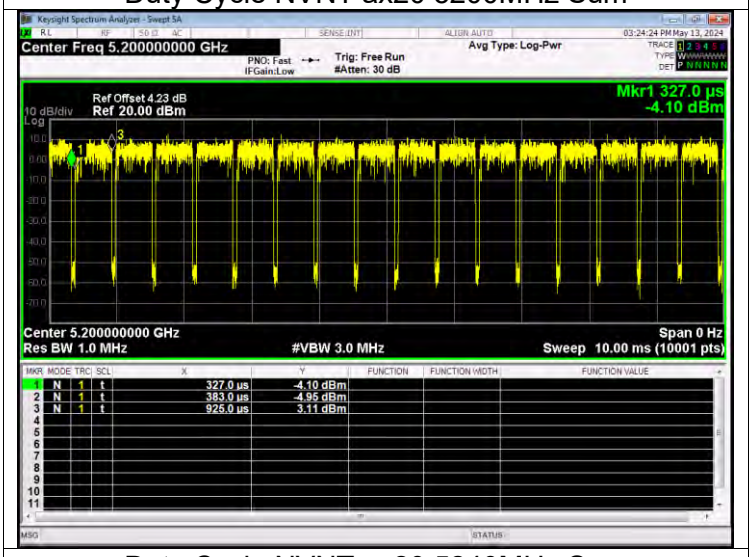

Duty Cycle NVNT ax20 5240MHz Sum

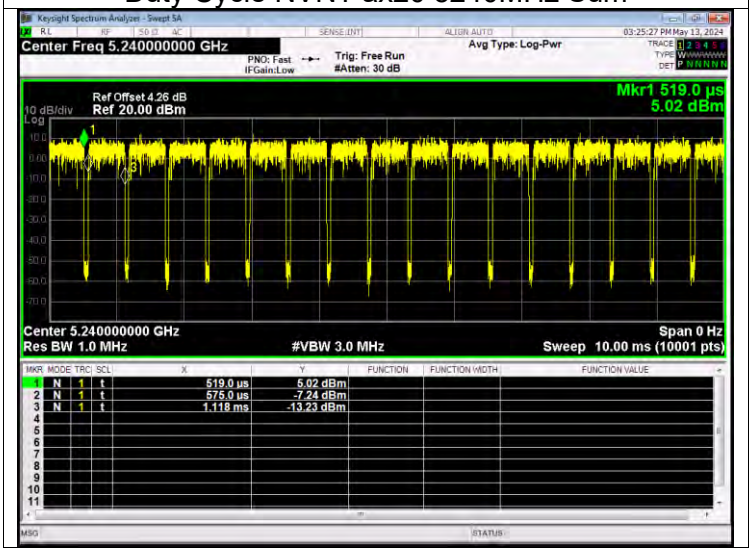

Duty Cycle NVNT ax20 5260MHz Sum

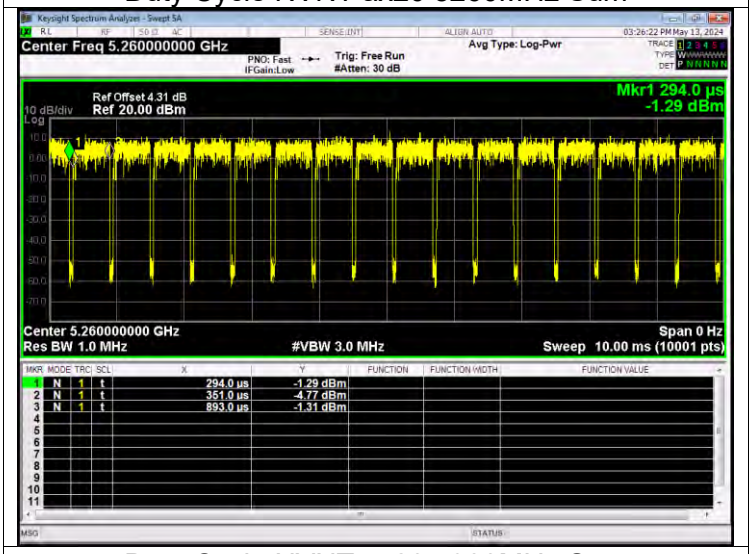

Duty Cycle NVNT ax20 5300MHz Sum

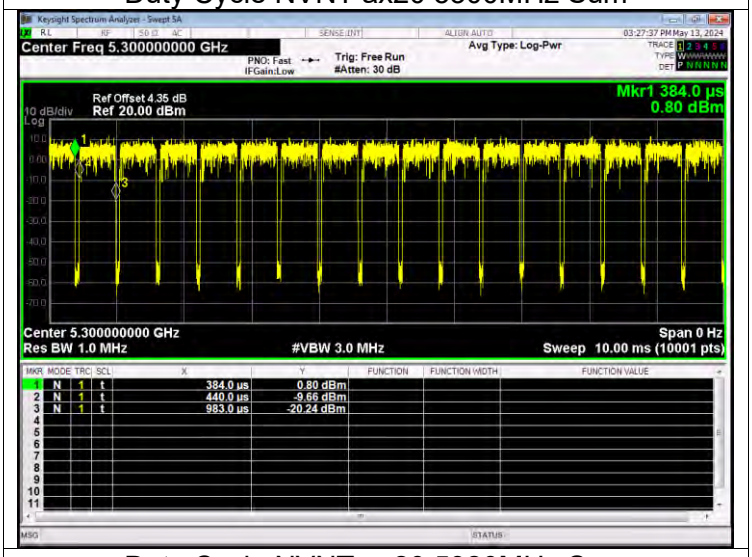

Duty Cycle NVNT ax20 5320MHz Sum

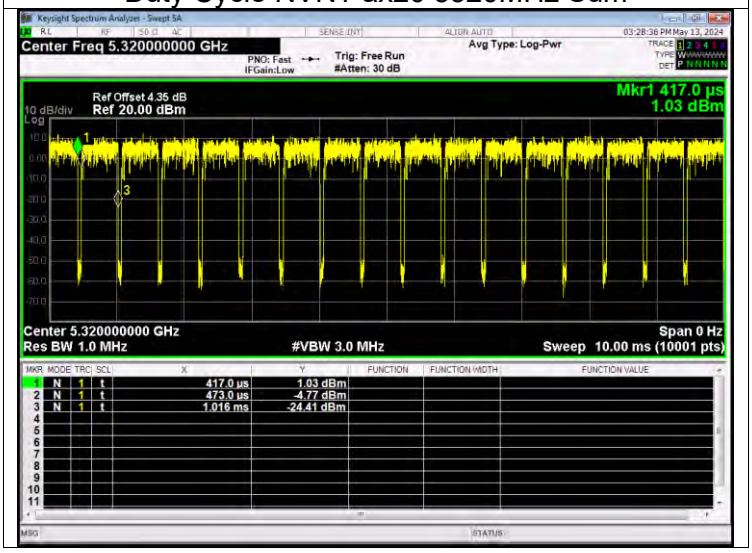

Duty Cycle NVNT ax20 5500MHz Sum

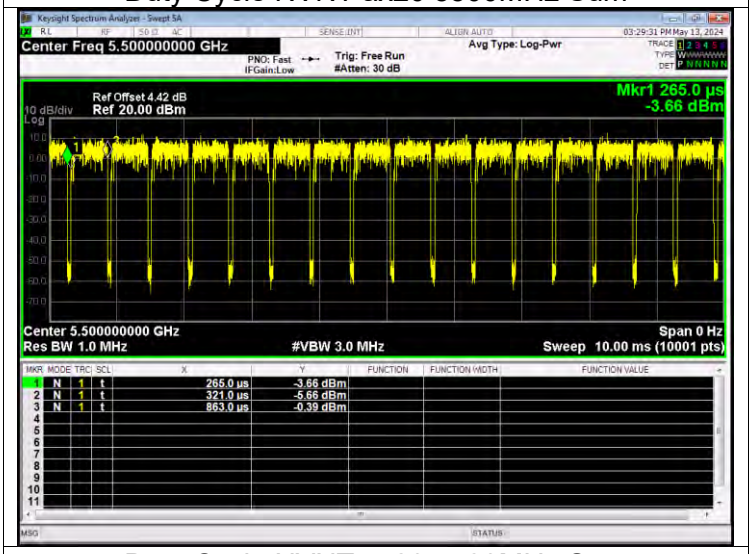

Duty Cycle NVNT ax20 5580MHz Sum

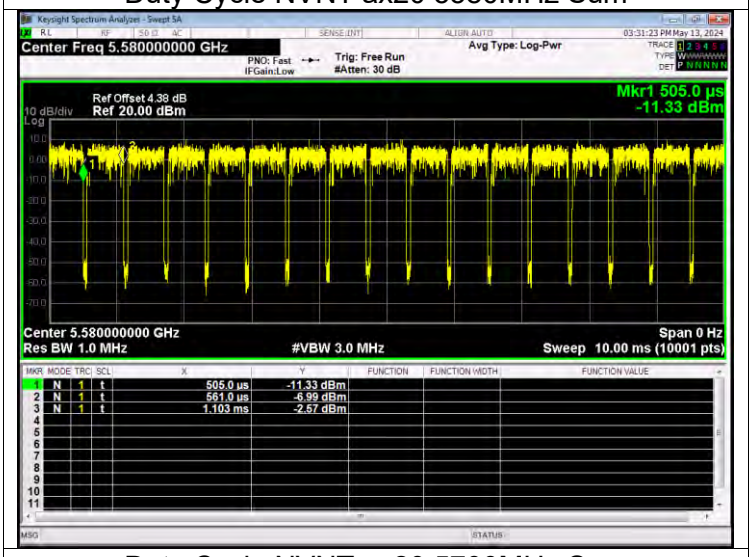

Duty Cycle NVNT ax20 5700MHz Sum

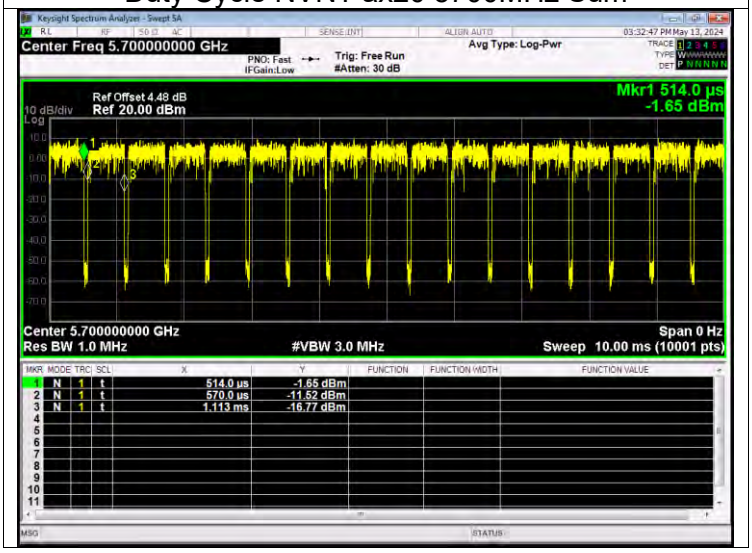

Duty Cycle NVNT ax20 5745MHz Sum

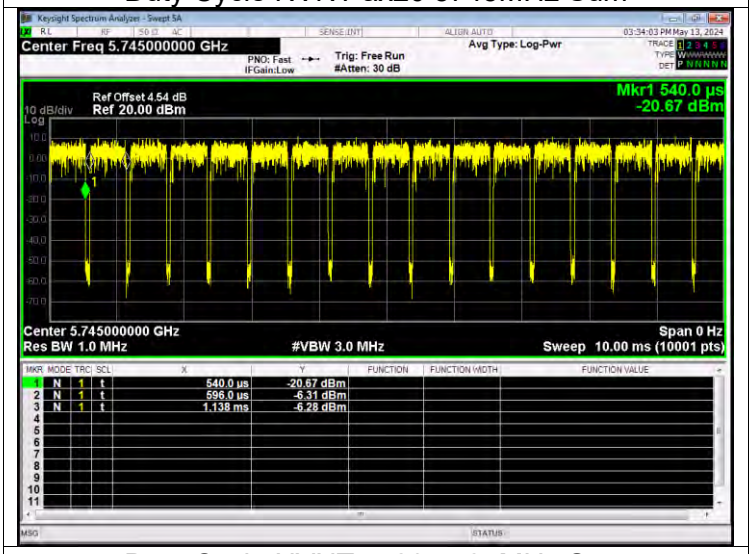

Duty Cycle NVNT ax20 5785MHz Sum

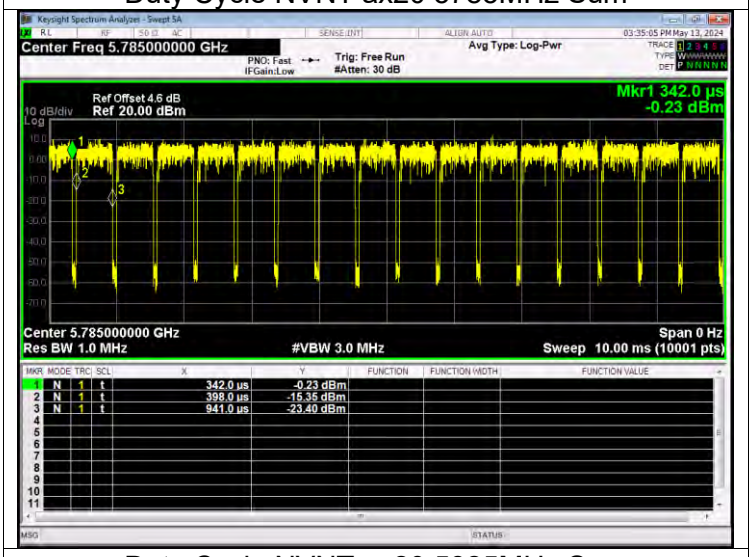

Duty Cycle NVNT ax20 5825MHz Sum

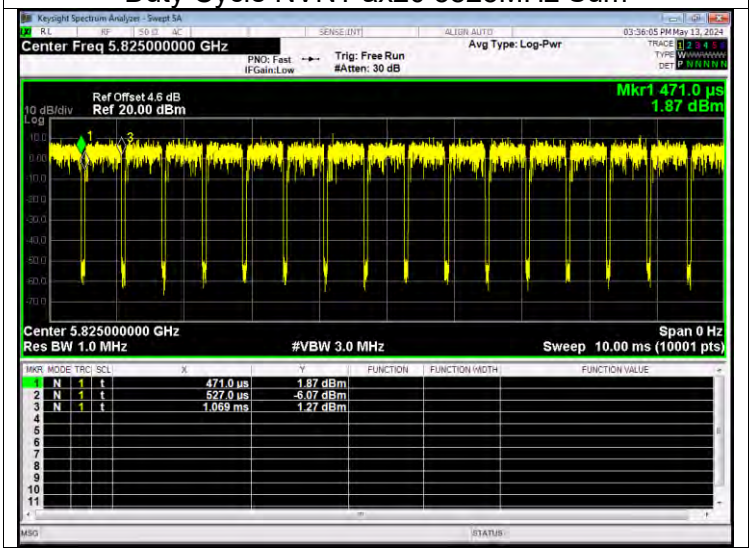

Duty Cycle NVNT ax40 5190MHz Ant1

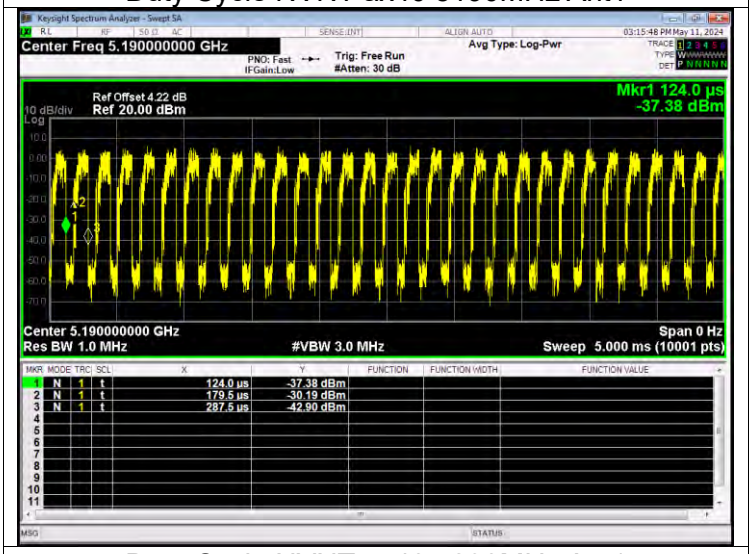

Duty Cycle NVNT ax40 5230MHz Ant1

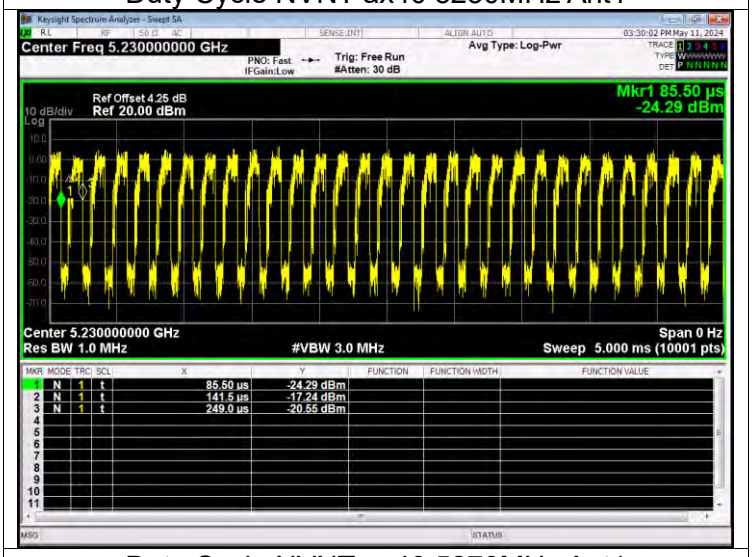

Duty Cycle NVNT ax40 5270MHz Ant1

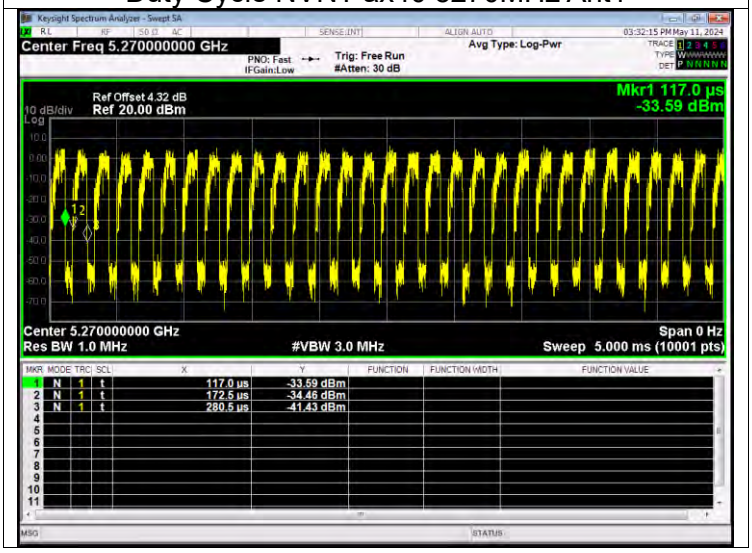

Duty Cycle NVNT ax40 5310MHz Ant1

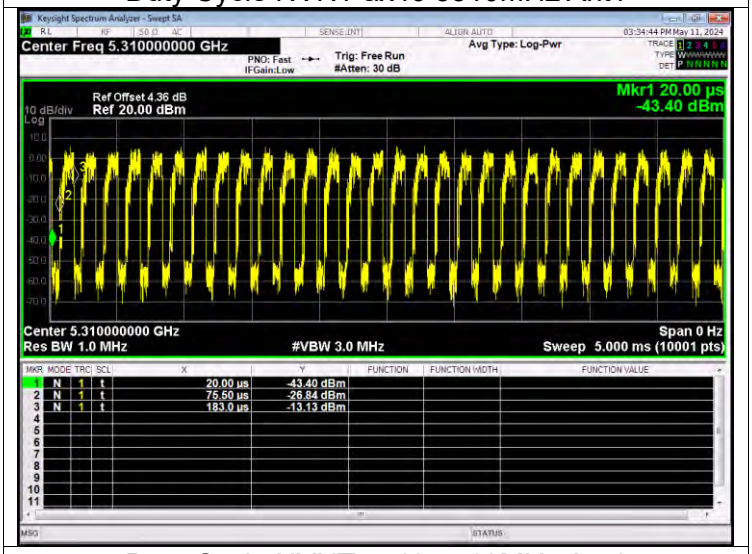

Duty Cycle NVNT ax40 5510MHz Ant1

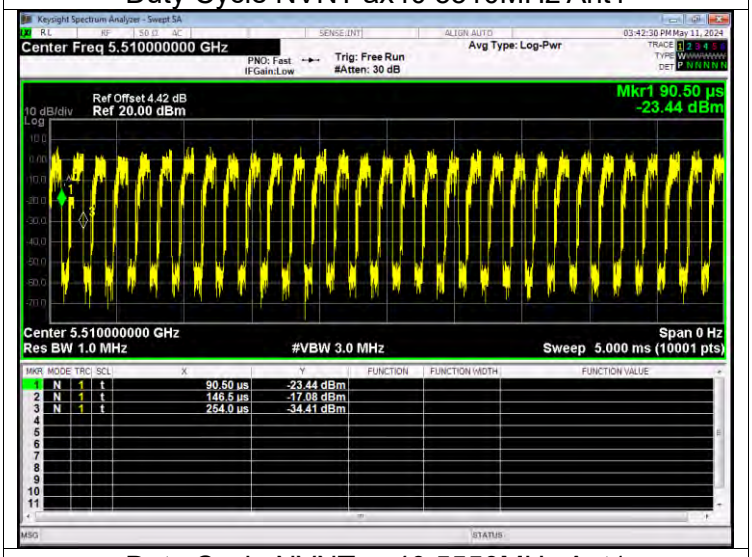

Duty Cycle NVNT ax40 5550MHz Ant1

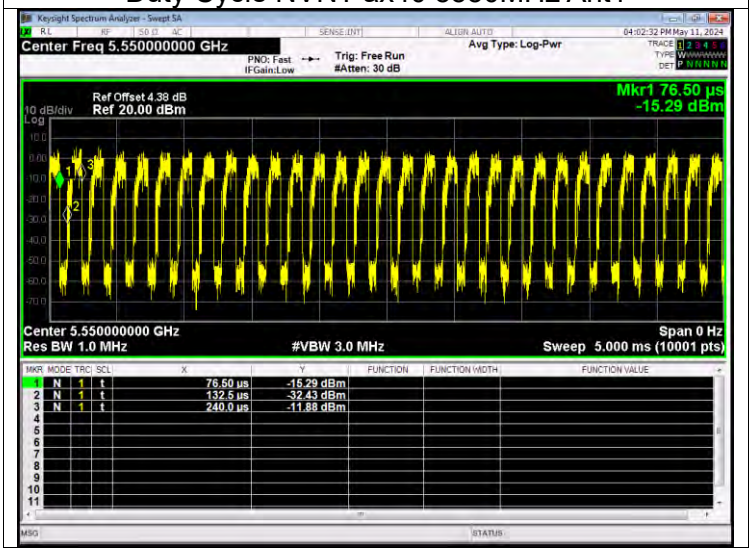

Duty Cycle NVNT ax40 5670MHz Ant1

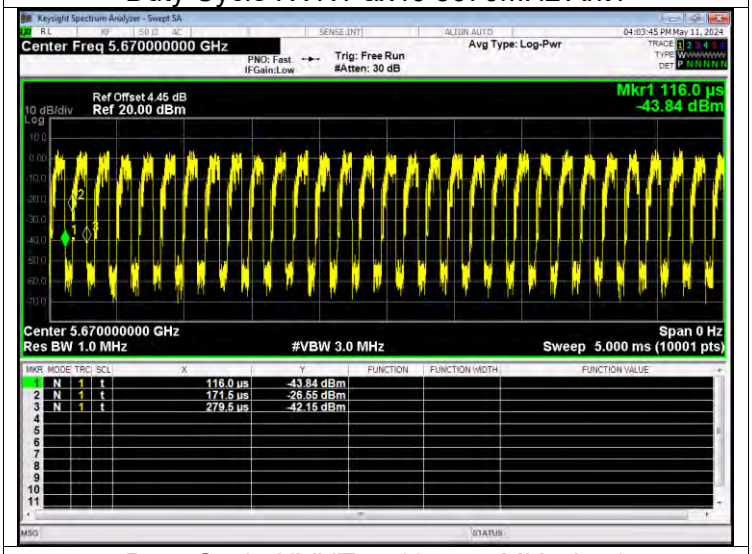

Duty Cycle NVNT ax40 5755MHz Ant1

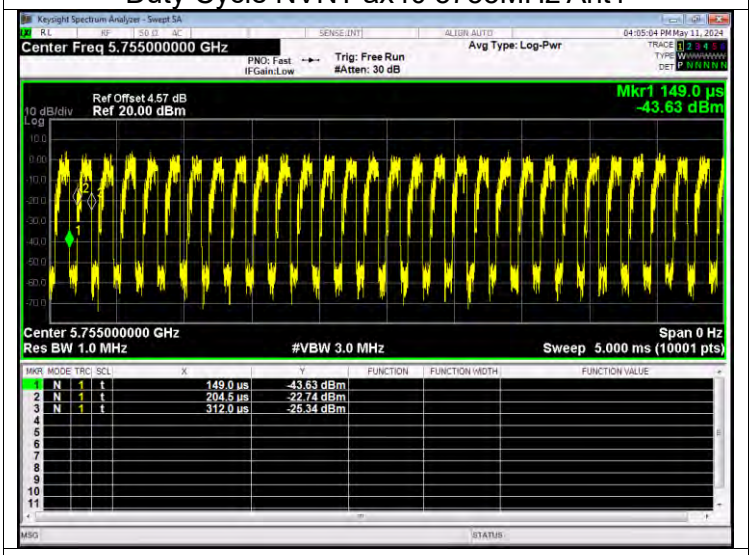

Duty Cycle NVNT ax40 5795MHz Ant1

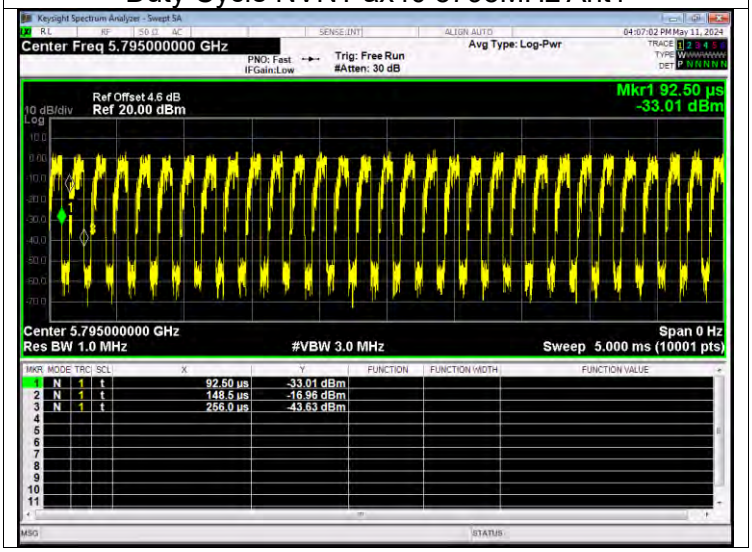

Duty Cycle NVNT ax40 5190MHz Ant2

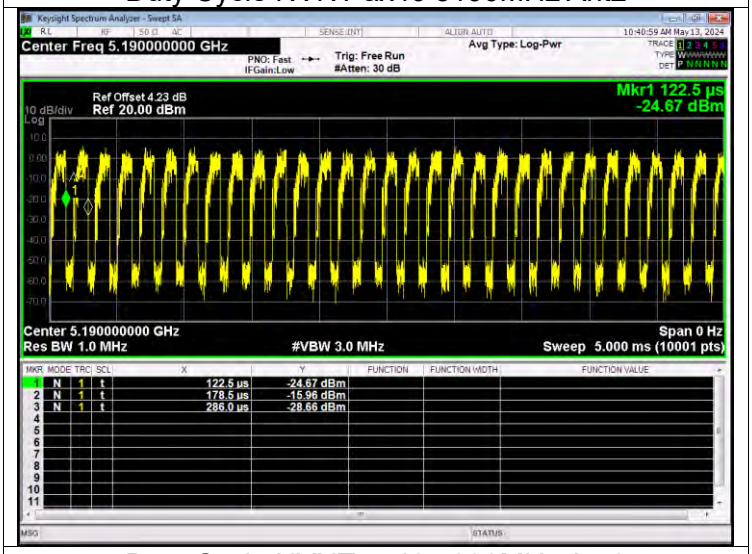

Duty Cycle NVNT ax40 5230MHz Ant2

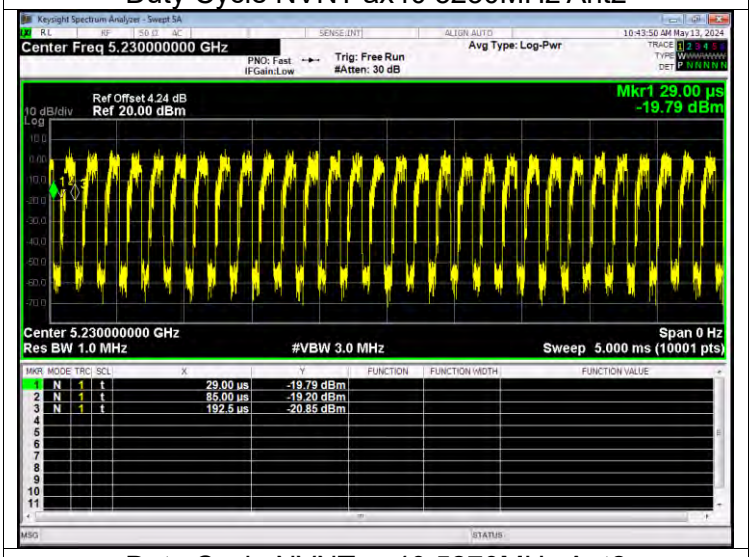

Duty Cycle NVNT ax40 5270MHz Ant2

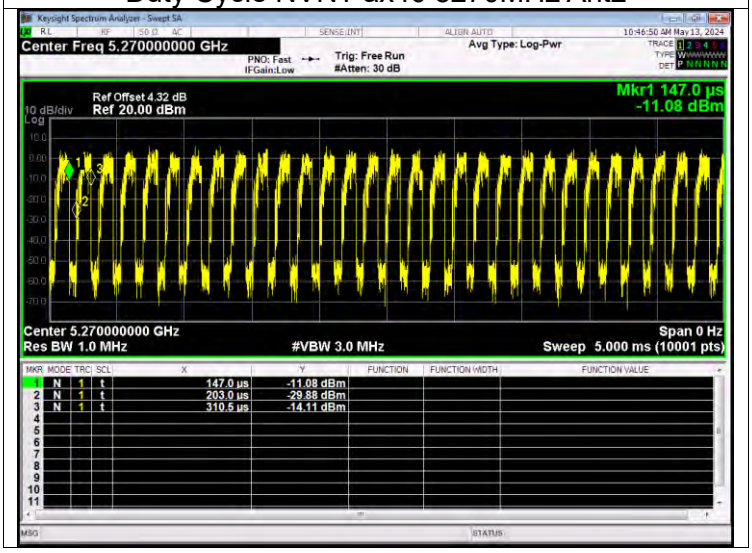

Duty Cycle NVNT ax40 5310MHz Ant2

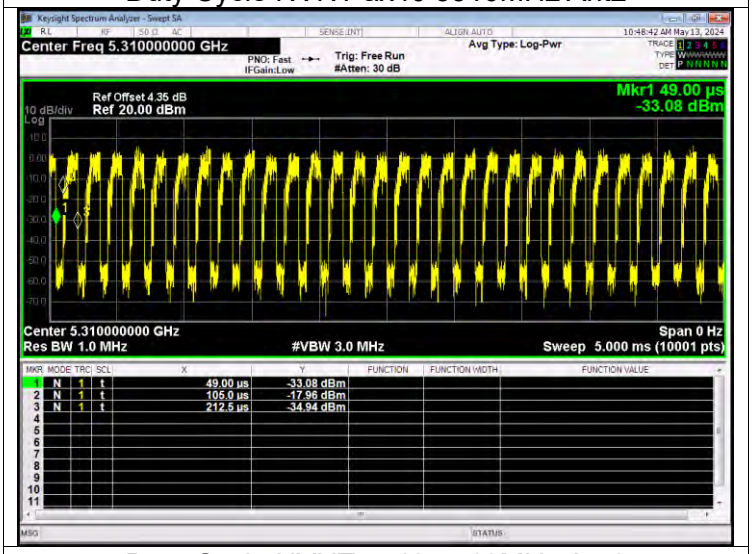

Duty Cycle NVNT ax40 5510MHz Ant2

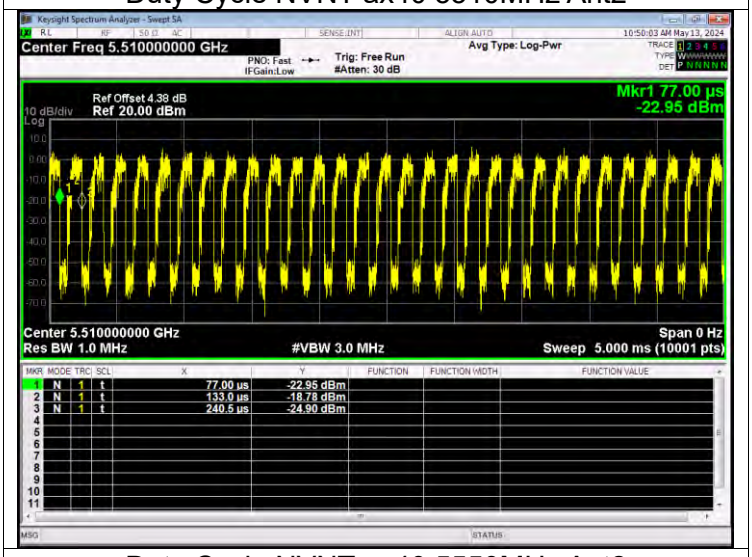

Duty Cycle NVNT ax40 5550MHz Ant2

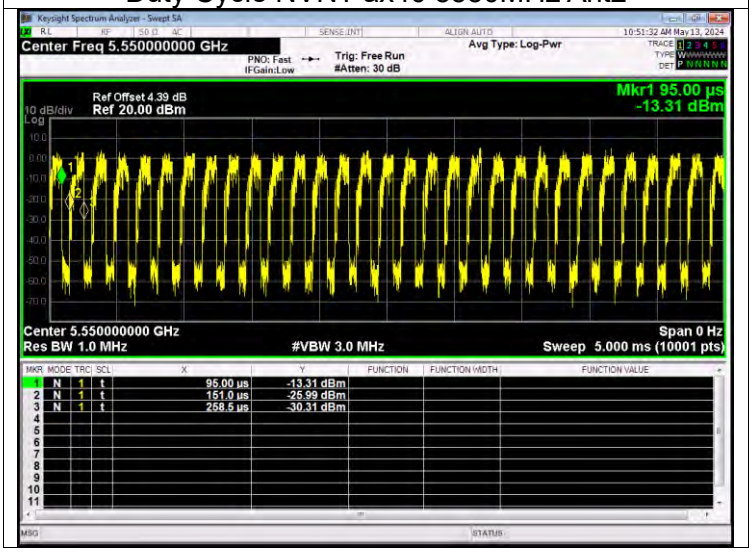

Duty Cycle NVNT ax40 5670MHz Ant2

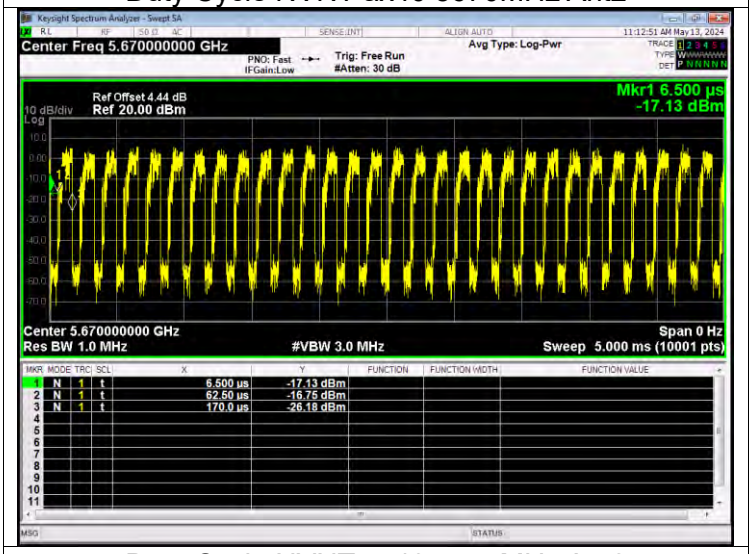

Duty Cycle NVNT ax40 5755MHz Ant2

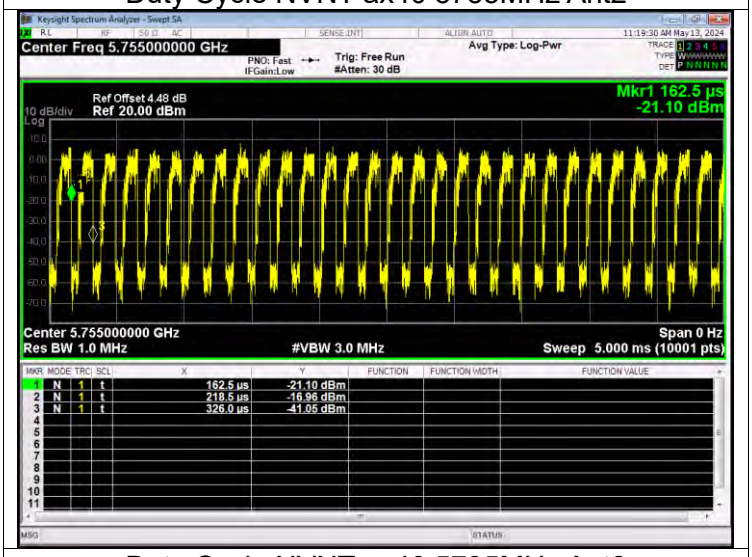

Duty Cycle NVNT ax40 5795MHz Ant2

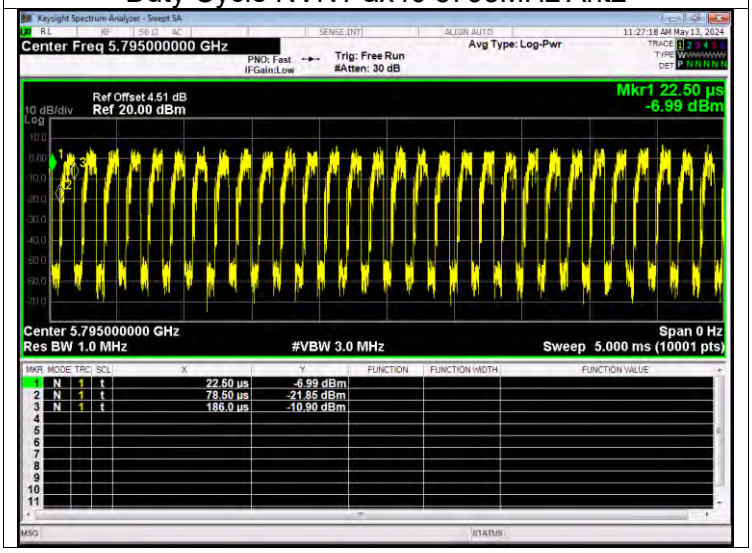

Duty Cycle NVNT ax40 5190MHz Sum

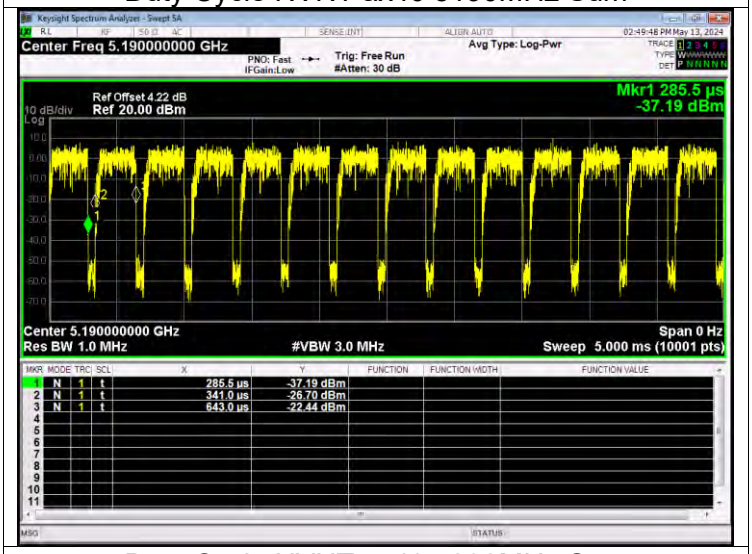

Duty Cycle NVNT ax40 5230MHz Sum

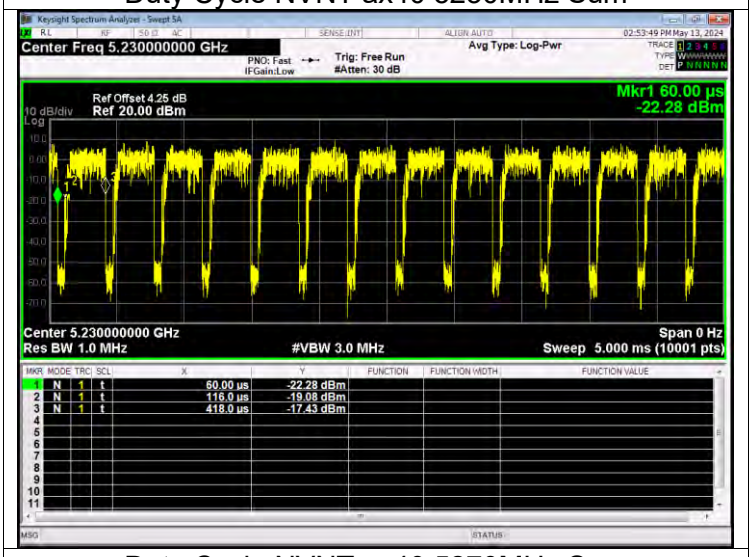

Duty Cycle NVNT ax40 5270MHz Sum

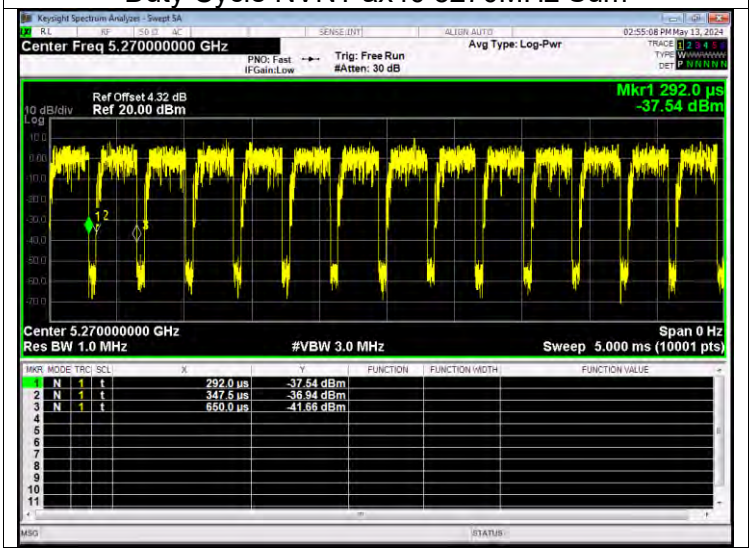

Duty Cycle NVNT ax40 5310MHz Sum

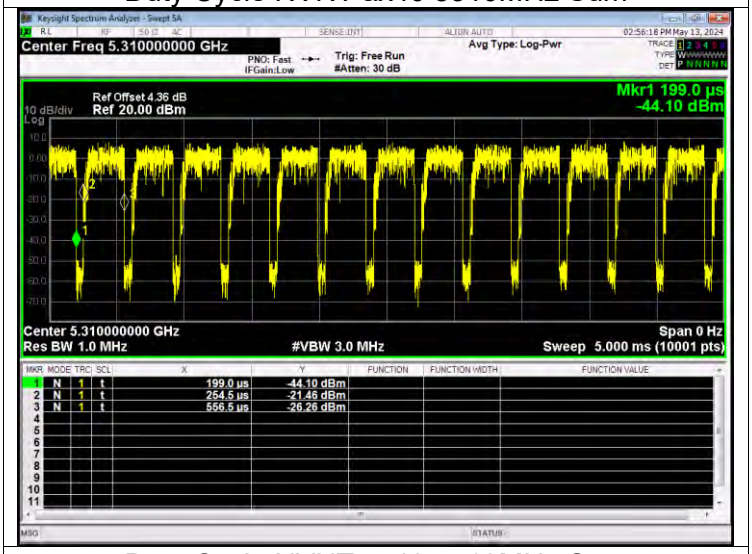

Duty Cycle NVNT ax40 5510MHz Sum

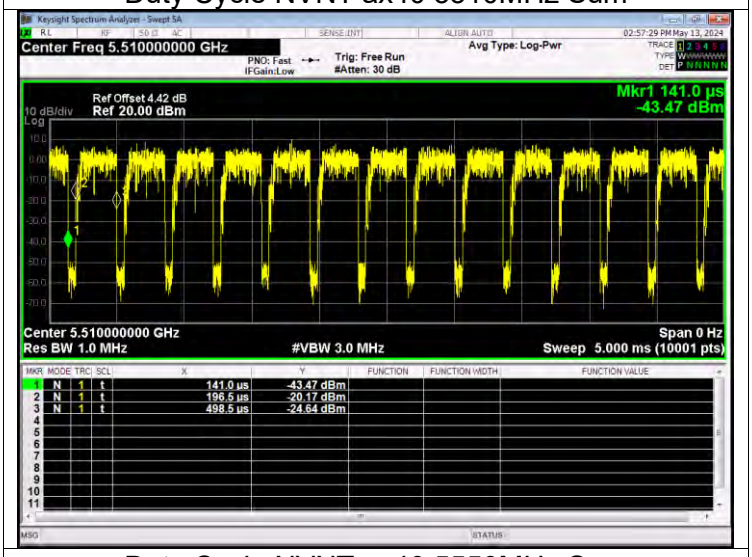

Duty Cycle NVNT ax40 5550MHz Sum

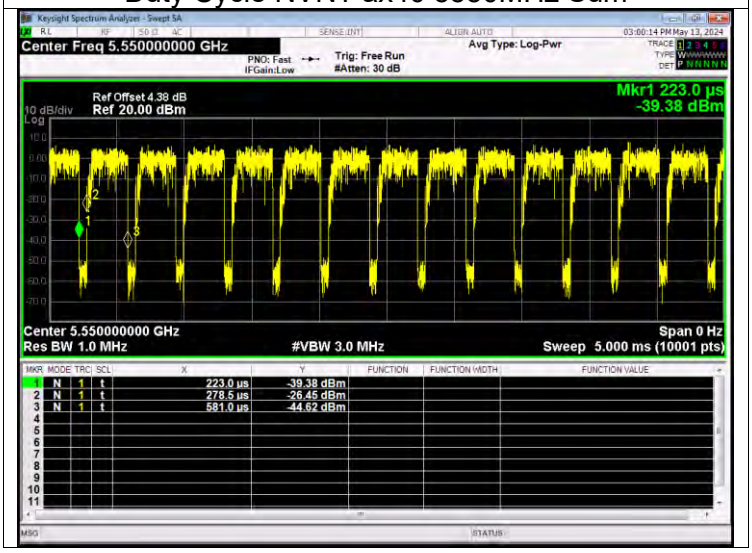

Duty Cycle NVNT ax40 5670MHz Sum

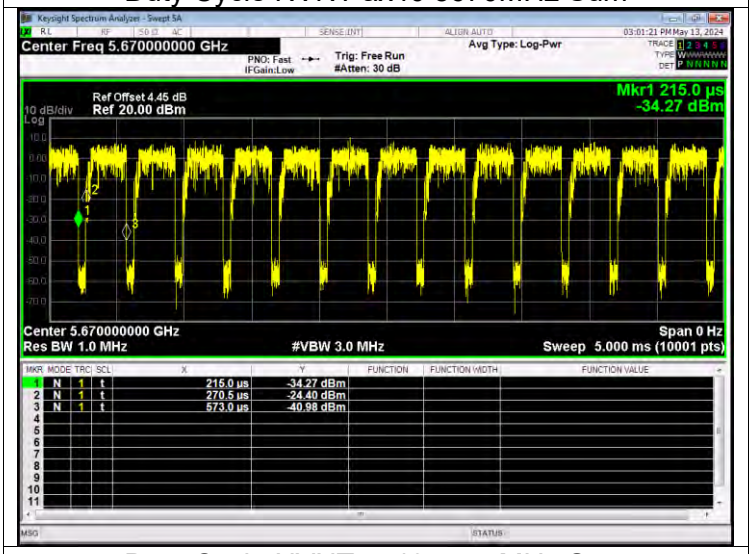

Duty Cycle NVNT ax40 5755MHz Sum

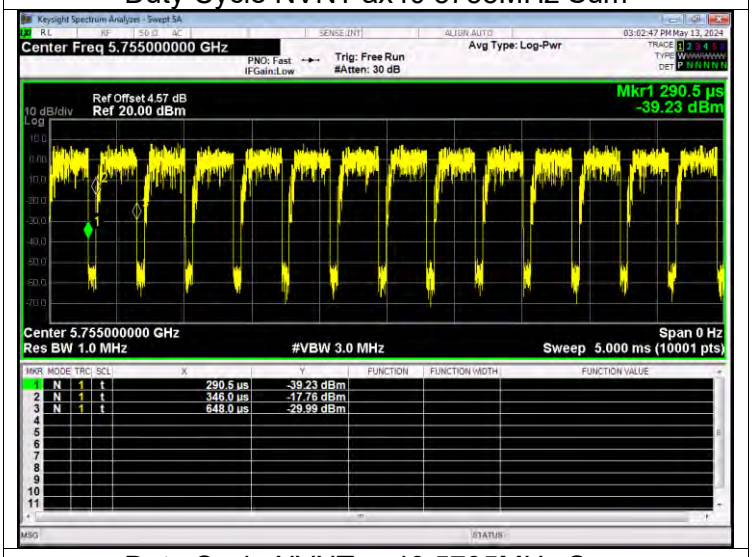

Duty Cycle NVNT ax40 5795MHz Sum

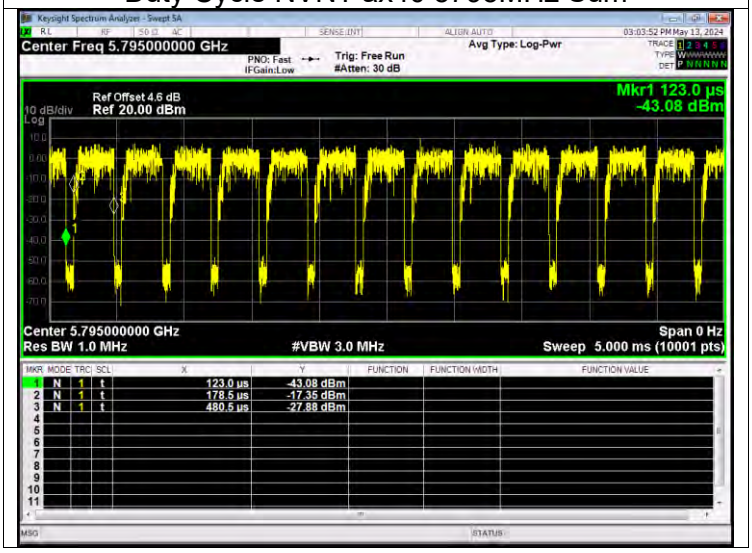

Duty Cycle NVNT ax80 5210MHz Ant1

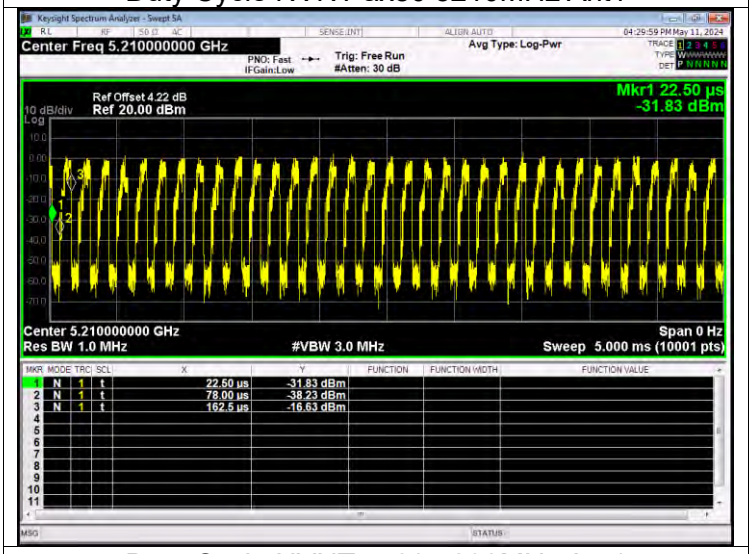

Duty Cycle NVNT ax80 5290MHz Ant1

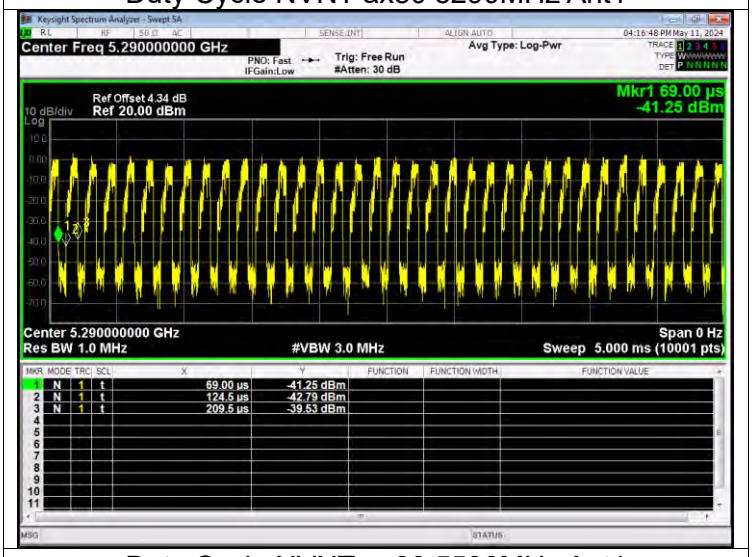

Duty Cycle NVNT ax80 5530MHz Ant1

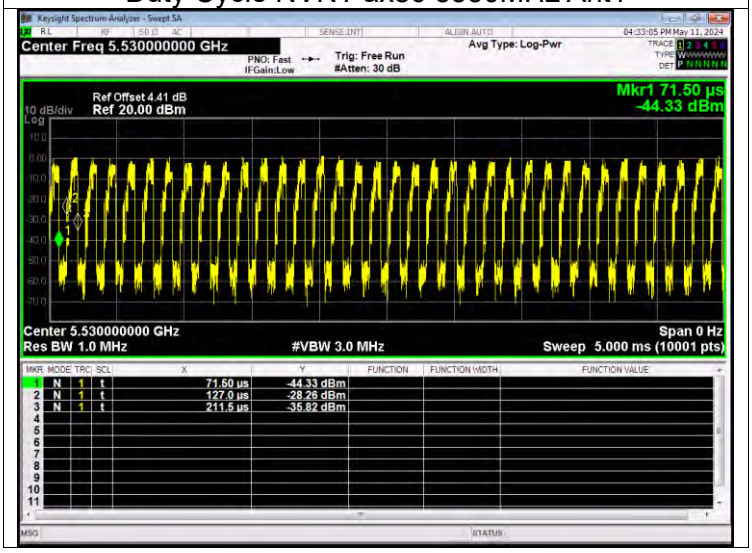

Duty Cycle NVNT ax80 5610MHz Ant1

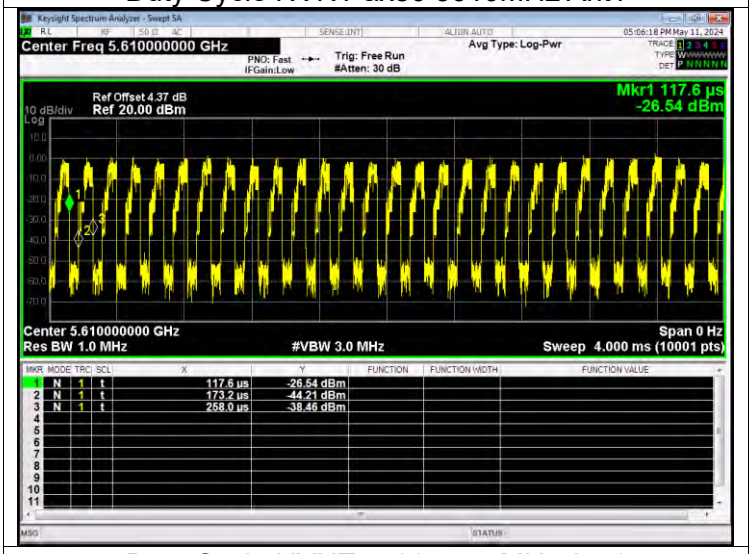

Duty Cycle NVNT ax80 5775MHz Ant1

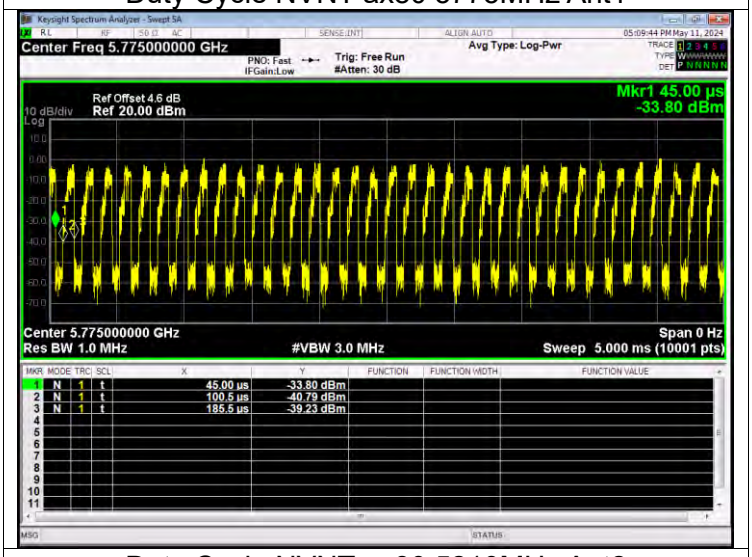

Duty Cycle NVNT ax80 5210MHz Ant2

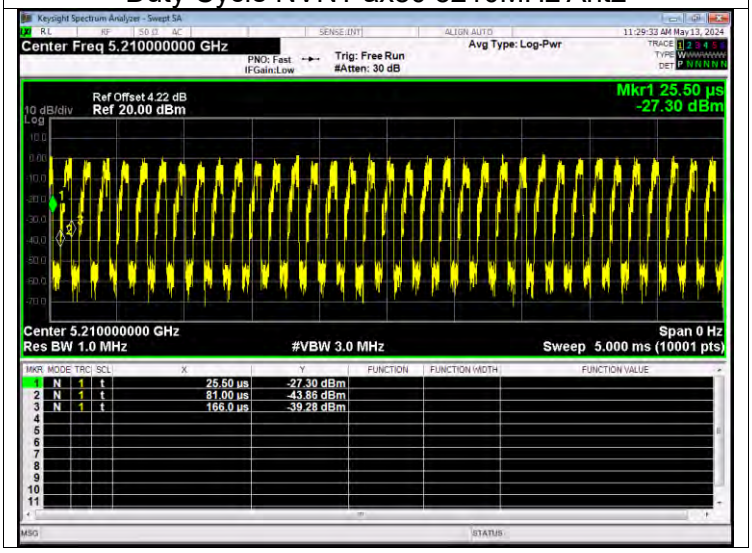

Duty Cycle NVNT ax80 5290MHz Ant2

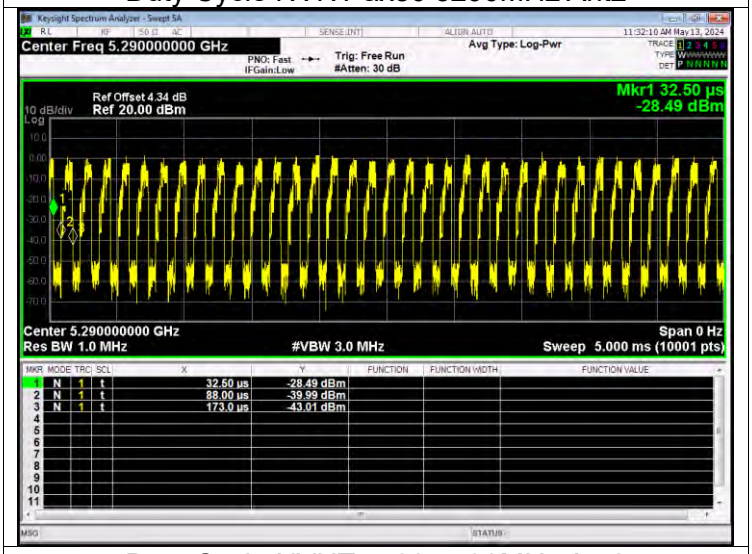

Duty Cycle NVNT ax80 5530MHz Ant2

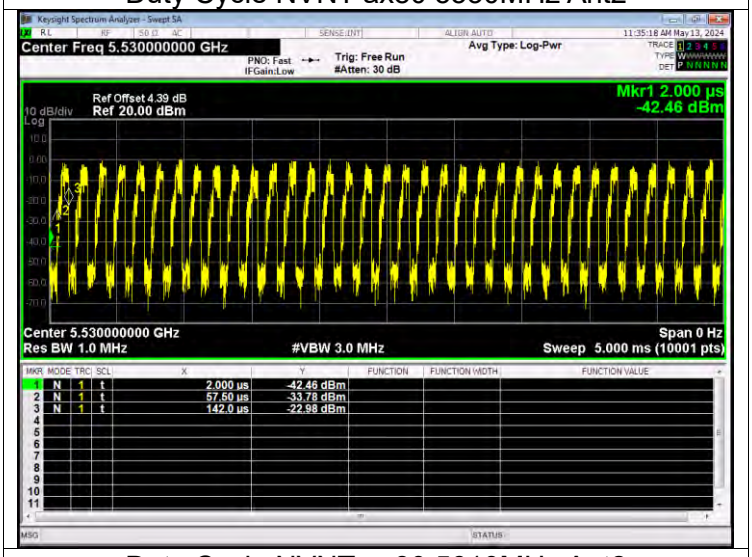

Duty Cycle NVNT ax80 5610MHz Ant2

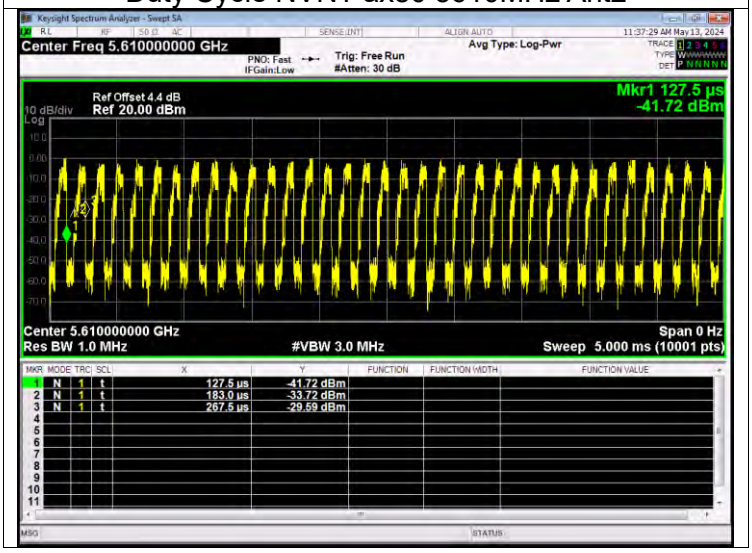

Duty Cycle NVNT ax80 5775MHz Ant2

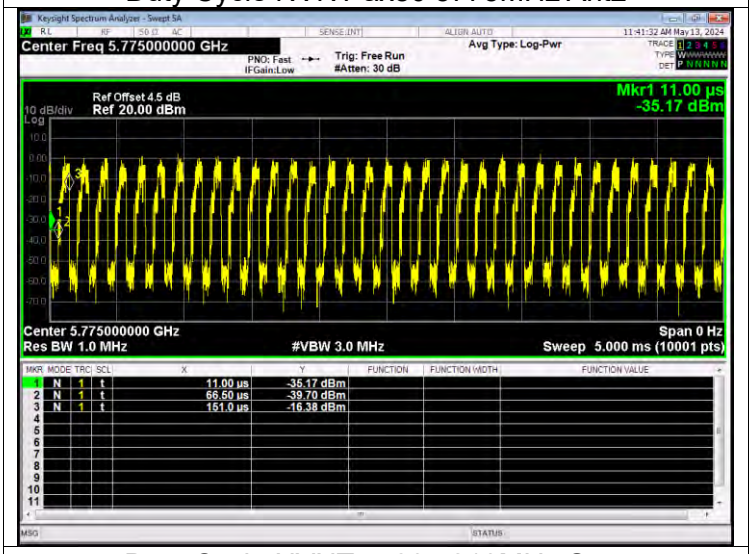

Duty Cycle NVNT ax80 5210MHz Sum

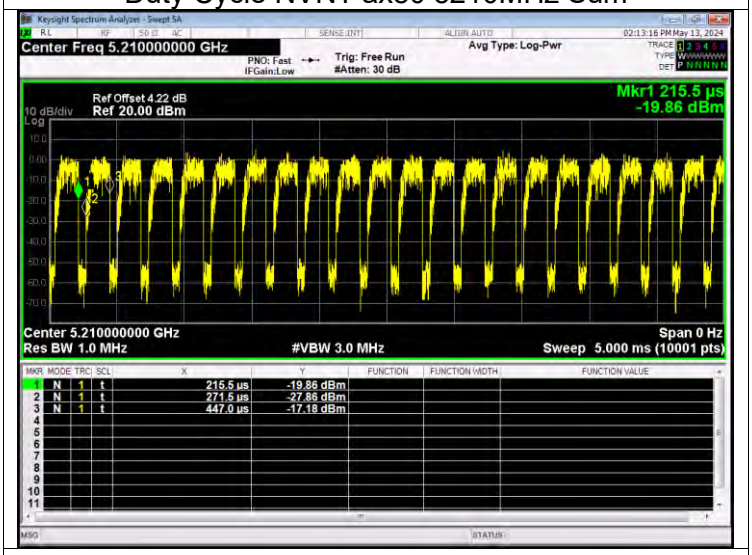

Duty Cycle NVNT ax80 5290MHz Sum

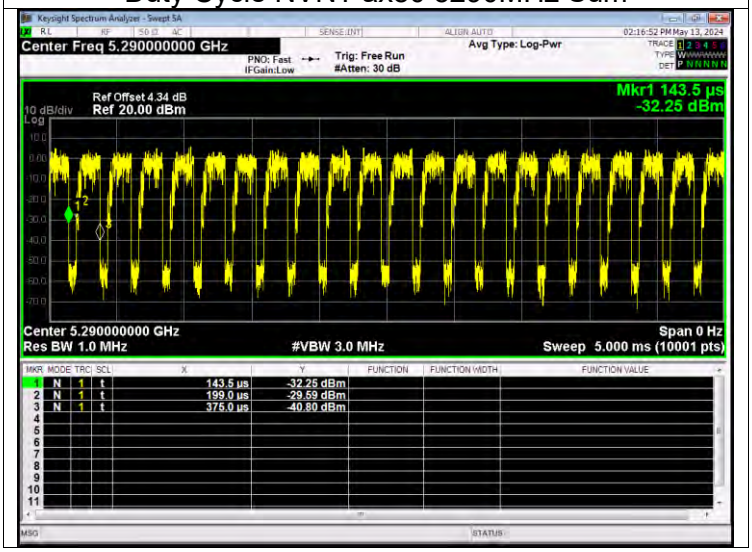

Duty Cycle NVNT ax80 5530MHz Sum

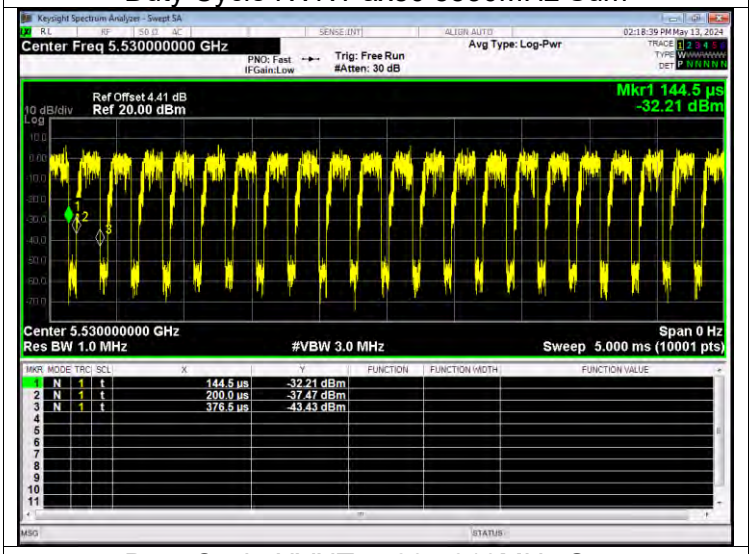

Duty Cycle NVNT ax80 5610MHz Sum

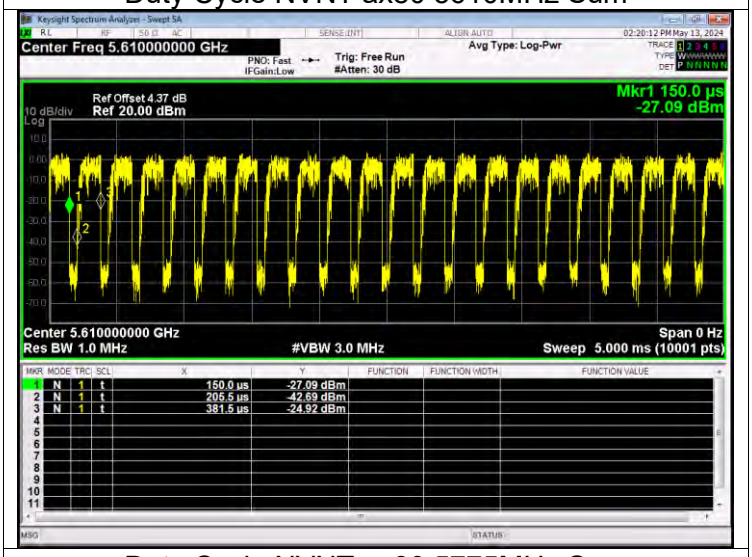

Duty Cycle NVNT ax80 5775MHz Sum

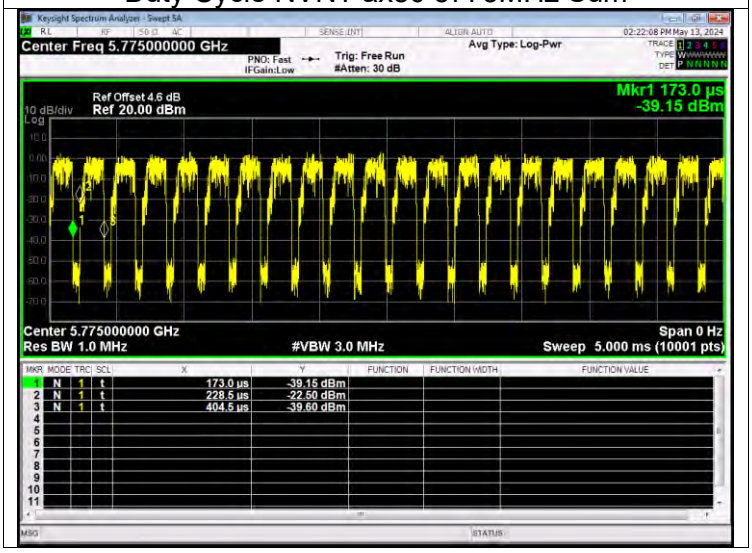

Duty Cycle NVNT ax160 5250MHz Ant1

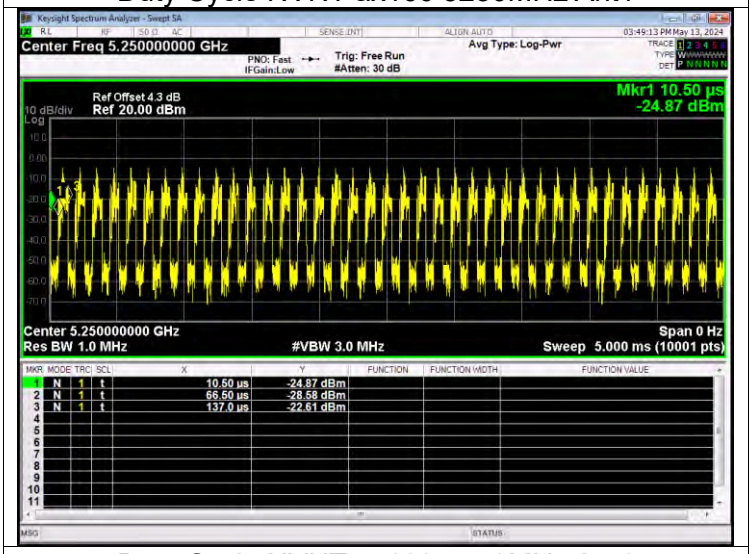

Duty Cycle NVNT ax160 5570MHz Ant1

Duty Cycle NVNT ax160 5250MHz Ant2

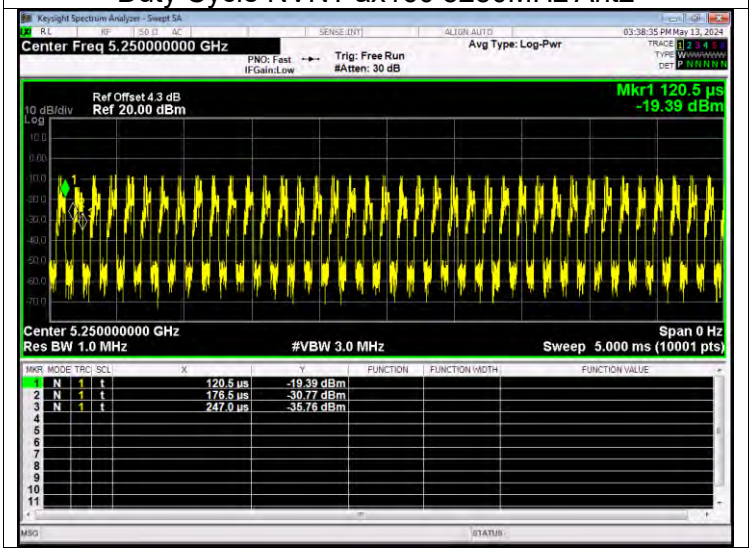

Duty Cycle NVNT ax160 5570MHz Ant2

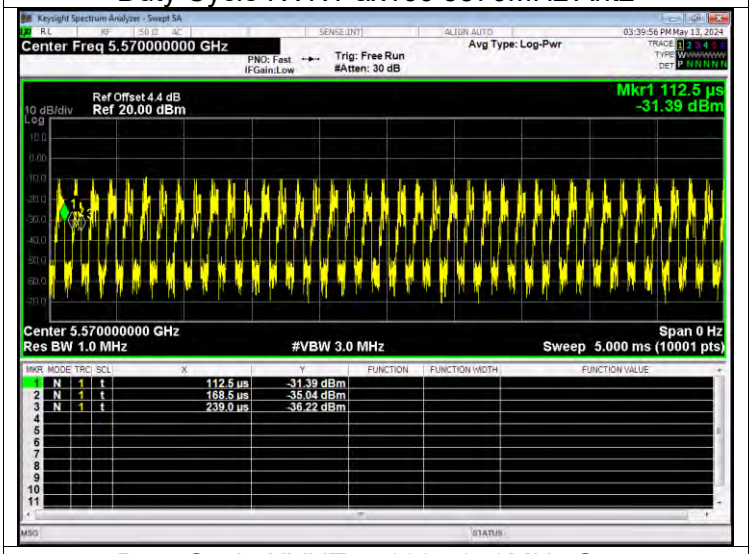

Duty Cycle NVNT ax160 5250MHz Sum

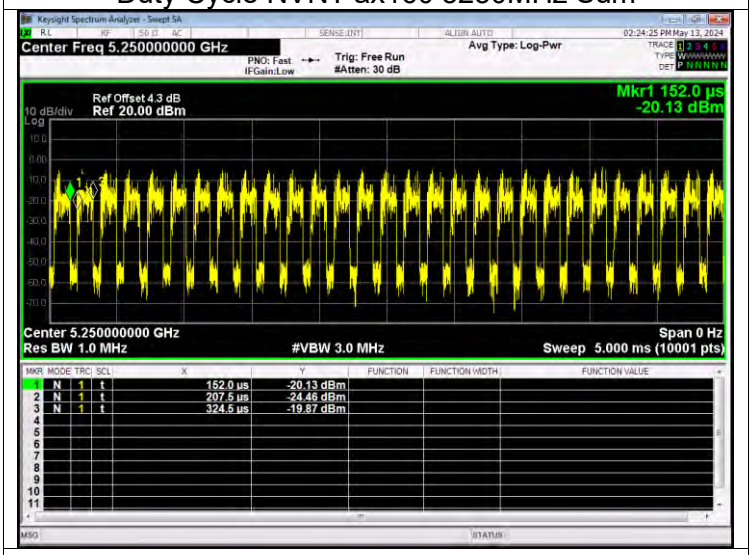

Duty Cycle NVNT ax160 5570MHz Sum

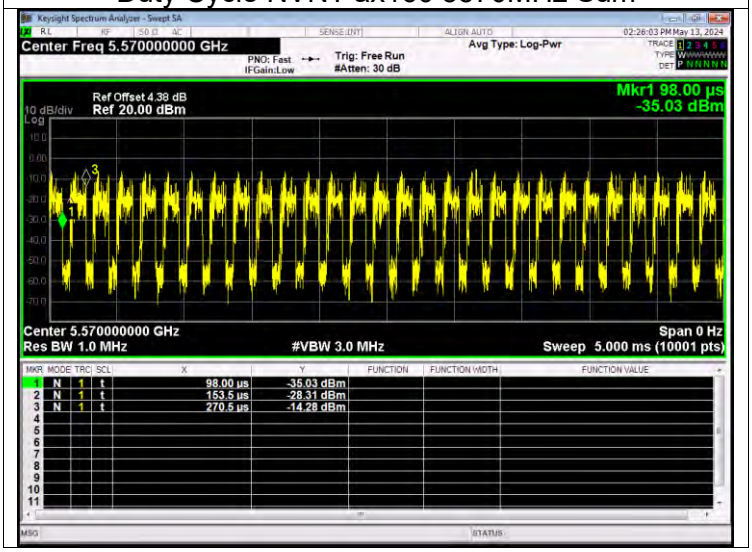

Maximum Conducted Output Power

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	16.14	1.19	17.33	30	Pass
NVNT	a	5200	Ant1	16.07	1.19	17.26	30	Pass
NVNT	a	5240	Ant1	16.17	1.2	17.37	30	Pass
NVNT	a	5260	Ant1	16.13	1.19	17.32	24	Pass
NVNT	a	5300	Ant1	15.89	1.19	17.08	24	Pass
NVNT	a	5320	Ant1	16.08	1.19	17.27	24	Pass
NVNT	a	5500	Ant1	16.44	1.19	17.63	24	Pass
NVNT	a	5580	Ant1	15.27	1.19	16.46	24	Pass
NVNT	a	5700	Ant1	14.7	1.19	15.89	24	Pass
NVNT	a	5745	Ant1	13.64	1.19	14.83	30	Pass
NVNT	a	5785	Ant1	13.95	1.19	15.14	30	Pass
NVNT	a	5825	Ant1	13.78	1.19	14.97	30	Pass
NVNT	a	5180	Ant2	16.29	1.19	17.48	30	Pass
NVNT	a	5200	Ant2	15.97	1.19	17.16	30	Pass
NVNT	a	5240	Ant2	15.65	1.2	16.85	30	Pass
NVNT	a	5260	Ant2	15.92	1.19	17.11	24	Pass
NVNT	a	5300	Ant2	15.64	1.19	16.83	24	Pass
NVNT	a	5320	Ant2	15.73	1.19	16.92	24	Pass
NVNT	a	5500	Ant2	15.43	1.19	16.62	24	Pass
NVNT	a	5580	Ant2	15.37	1.19	16.56	24	Pass
NVNT	a	5700	Ant2	15.77	1.19	16.96	24	Pass
NVNT	a	5745	Ant2	16.08	1.19	17.27	30	Pass
NVNT	a	5785	Ant2	16.48	1.19	17.67	30	Pass
NVNT	a	5825	Ant2	16.71	1.19	17.9	30	Pass
NVNT	n20	5180	Ant1	15.19	1.27	16.46	30	Pass
NVNT	n20	5200	Ant1	15.09	1.27	16.36	30	Pass
NVNT	n20	5240	Ant1	15.04	1.29	16.33	30	Pass
NVNT	n20	5260	Ant1	15.14	1.27	16.41	24	Pass
NVNT	n20	5300	Ant1	14.99	1.27	16.26	24	Pass
NVNT	n20	5320	Ant1	15.08	1.27	16.35	24	Pass
NVNT	n20	5500	Ant1	15.44	1.27	16.71	24	Pass
NVNT	n20	5580	Ant1	14.23	1.27	15.5	24	Pass
NVNT	n20	5700	Ant1	13.67	1.27	14.94	24	Pass
NVNT	n20	5745	Ant1	12.59	1.27	13.86	30	Pass
NVNT	n20	5785	Ant1	12.95	1.27	14.22	30	Pass
NVNT	n20	5825	Ant1	12.75	1.27	14.02	30	Pass
NVNT	n20	5180	Ant2	15.29	1.27	16.56	30	Pass
NVNT	n20	5200	Ant2	14.91	1.27	16.18	30	Pass
NVNT	n20	5240	Ant2	14.69	1.28	15.97	30	Pass
NVNT	n20	5260	Ant2	14.84	1.27	16.11	24	Pass
NVNT	n20	5300	Ant2	14.63	1.27	15.9	24	Pass
NVNT	n20	5320	Ant2	14.67	1.27	15.94	24	Pass
NVNT	n20	5500	Ant2	14.4	1.27	15.67	24	Pass
NVNT	n20	5580	Ant2	14.34	1.27	15.61	24	Pass
NVNT	n20	5700	Ant2	14.1	1.27	15.37	24	Pass
NVNT	n20	5745	Ant2	14.41	1.27	15.68	30	Pass
NVNT	n20	5785	Ant2	14.62	1.27	15.89	30	Pass
NVNT	n20	5825	Ant2	14.83	1.27	16.1	30	Pass
NVNT	n20	5180	Ant1	15.01	0.35	15.36	30	Pass
NVNT	n20	5180	Ant2	15.15	0.35	15.5	30	Pass
NVNT	n20	5180	Sum	18.09	0.35	18.44	30	Pass

NVNT	n20	5200	Ant1	14.97	0.35	15.32	30	Pass
NVNT	n20	5200	Ant2	14.71	0.35	15.06	30	Pass
NVNT	n20	5200	Sum	17.85	0.35	18.2	30	Pass
NVNT	n20	5240	Ant1	15.3	0.35	15.65	30	Pass
NVNT	n20	5240	Ant2	14.65	0.35	15	30	Pass
NVNT	n20	5240	Sum	18	0.35	18.35	30	Pass
NVNT	n20	5260	Ant1	15.32	0.35	15.67	24	Pass
NVNT	n20	5260	Ant2	14.9	0.35	15.25	24	Pass
NVNT	n20	5260	Sum	18.13	0.35	18.48	24	Pass
NVNT	n20	5300	Ant1	15.17	0.35	15.52	24	Pass
NVNT	n20	5300	Ant2	14.79	0.35	15.14	24	Pass
NVNT	n20	5300	Sum	17.99	0.35	18.34	24	Pass
NVNT	n20	5320	Ant1	15.3	0.35	15.65	24	Pass
NVNT	n20	5320	Ant2	14.73	0.35	15.08	24	Pass
NVNT	n20	5320	Sum	18.03	0.35	18.38	24	Pass
NVNT	n20	5500	Ant1	13.58	0.35	13.93	24	Pass
NVNT	n20	5500	Ant2	12.43	0.35	12.78	24	Pass
NVNT	n20	5500	Sum	16.05	0.35	16.4	24	Pass
NVNT	n20	5580	Ant1	13.31	0.35	13.66	24	Pass
NVNT	n20	5580	Ant2	13.15	0.35	13.5	24	Pass
NVNT	n20	5580	Sum	16.24	0.35	16.59	24	Pass
NVNT	n20	5700	Ant1	12.64	0.35	12.99	24	Pass
NVNT	n20	5700	Ant2	13.46	0.35	13.81	24	Pass
NVNT	n20	5700	Sum	16.08	0.35	16.43	24	Pass
NVNT	n20	5745	Ant1	12.66	0.35	13.01	30	Pass
NVNT	n20	5745	Ant2	13.82	0.35	14.17	30	Pass
NVNT	n20	5745	Sum	16.29	0.35	16.64	30	Pass
NVNT	n20	5785	Ant1	13.11	0.35	13.46	30	Pass
NVNT	n20	5785	Ant2	14.37	0.35	14.72	30	Pass
NVNT	n20	5785	Sum	16.8	0.35	17.15	30	Pass
NVNT	n20	5825	Ant1	13	0.35	13.35	30	Pass
NVNT	n20	5825	Ant2	14.7	0.35	15.05	30	Pass
NVNT	n20	5825	Sum	16.94	0.35	17.29	30	Pass
NVNT	n40	5190	Ant1	14.41	1.89	16.3	30	Pass
NVNT	n40	5230	Ant1	14.22	1.89	16.11	30	Pass
NVNT	n40	5270	Ant1	14.18	1.89	16.07	24	Pass
NVNT	n40	5310	Ant1	14.35	1.89	16.24	24	Pass
NVNT	n40	5510	Ant1	14.69	1.89	16.58	24	Pass
NVNT	n40	5550	Ant1	14.16	1.89	16.05	24	Pass
NVNT	n40	5670	Ant1	13.93	1.89	15.82	24	Pass
NVNT	n40	5755	Ant1	11.99	1.89	13.88	30	Pass
NVNT	n40	5795	Ant1	12.05	1.89	13.94	30	Pass
NVNT	n40	5190	Ant2	13.76	1.89	15.65	30	Pass
NVNT	n40	5230	Ant2	13.9	1.89	15.79	30	Pass
NVNT	n40	5270	Ant2	13.85	1.89	15.74	24	Pass
NVNT	n40	5310	Ant2	13.57	1.89	15.46	24	Pass
NVNT	n40	5510	Ant2	12.62	1.89	14.51	24	Pass
NVNT	n40	5550	Ant2	12.62	1.89	14.51	24	Pass
NVNT	n40	5670	Ant2	13.87	1.89	15.76	24	Pass
NVNT	n40	5755	Ant2	13.99	1.89	15.88	30	Pass
NVNT	n40	5795	Ant2	14.37	1.89	16.26	30	Pass
NVNT	n40	5190	Ant1	14.86	0.64	15.5	30	Pass
NVNT	n40	5190	Ant2	14.7	0.64	15.34	30	Pass
NVNT	n40	5190	Sum	17.79	0.64	18.43	30	Pass
NVNT	n40	5230	Ant1	14.91	0.64	15.55	30	Pass
NVNT	n40	5230	Ant2	14.57	0.64	15.21	30	Pass

NVNT	n40	5230	Sum	17.75	0.64	18.39	30	Pass
NVNT	n40	5270	Ant1	14.86	0.64	15.5	24	Pass
NVNT	n40	5270	Ant2	14.42	0.64	15.06	24	Pass
NVNT	n40	5270	Sum	17.66	0.64	18.3	24	Pass
NVNT	n40	5310	Ant1	14.87	0.64	15.51	24	Pass
NVNT	n40	5310	Ant2	14.48	0.64	15.12	24	Pass
NVNT	n40	5310	Sum	17.69	0.64	18.33	24	Pass
NVNT	n40	5510	Ant1	14.35	0.64	14.99	24	Pass
NVNT	n40	5510	Ant2	13.4	0.64	14.04	24	Pass
NVNT	n40	5510	Sum	16.91	0.64	17.55	24	Pass
NVNT	n40	5550	Ant1	13.71	0.64	14.35	24	Pass
NVNT	n40	5550	Ant2	13.47	0.64	14.11	24	Pass
NVNT	n40	5550	Sum	16.6	0.64	17.24	24	Pass
NVNT	n40	5670	Ant1	13.55	0.64	14.19	24	Pass
NVNT	n40	5670	Ant2	13.61	0.64	14.25	24	Pass
NVNT	n40	5670	Sum	16.59	0.64	17.23	24	Pass
NVNT	n40	5755	Ant1	12.64	0.64	13.28	30	Pass
NVNT	n40	5755	Ant2	13.77	0.64	14.41	30	Pass
NVNT	n40	5755	Sum	16.25	0.64	16.89	30	Pass
NVNT	n40	5795	Ant1	12.79	0.64	13.43	30	Pass
NVNT	n40	5795	Ant2	14.21	0.64	14.85	30	Pass
NVNT	n40	5795	Sum	16.57	0.64	17.21	30	Pass
NVNT	ac20	5180	Ant1	13.71	1.23	14.94	30	Pass
NVNT	ac20	5200	Ant1	13.66	1.23	14.89	30	Pass
NVNT	ac20	5240	Ant1	13.57	1.23	14.8	30	Pass
NVNT	ac20	5260	Ant1	13.63	1.23	14.86	24	Pass
NVNT	ac20	5300	Ant1	13.51	1.23	14.74	24	Pass
NVNT	ac20	5320	Ant1	13.67	1.23	14.9	24	Pass
NVNT	ac20	5500	Ant1	15.45	1.22	16.67	24	Pass
NVNT	ac20	5580	Ant1	14.31	1.22	15.53	24	Pass
NVNT	ac20	5700	Ant1	13.87	1.22	15.09	24	Pass
NVNT	ac20	5745	Ant1	12.76	1.23	13.99	30	Pass
NVNT	ac20	5785	Ant1	13.07	1.22	14.29	30	Pass
NVNT	ac20	5825	Ant1	12.9	1.22	14.12	30	Pass
NVNT	ac20	5180	Ant2	13.76	1.22	14.98	30	Pass
NVNT	ac20	5200	Ant2	13.35	1.22	14.57	30	Pass
NVNT	ac20	5240	Ant2	13.18	1.23	14.41	30	Pass
NVNT	ac20	5260	Ant2	13.38	1.22	14.6	24	Pass
NVNT	ac20	5300	Ant2	13.21	1.22	14.43	24	Pass
NVNT	ac20	5320	Ant2	13.13	1.22	14.35	24	Pass
NVNT	ac20	5500	Ant2	13.26	1.22	14.48	24	Pass
NVNT	ac20	5580	Ant2	13.15	1.22	14.37	24	Pass
NVNT	ac20	5700	Ant2	12.25	1.22	13.47	24	Pass
NVNT	ac20	5745	Ant2	12.55	1.22	13.77	30	Pass
NVNT	ac20	5785	Ant2	12.74	1.22	13.96	30	Pass
NVNT	ac20	5825	Ant2	13.06	1.22	14.28	30	Pass
NVNT	ac20	5180	Ant1	14.09	0.34	14.43	30	Pass
NVNT	ac20	5180	Ant2	14.19	0.34	14.53	30	Pass
NVNT	ac20	5180	Sum	17.15	0.34	17.49	30	Pass
NVNT	ac20	5200	Ant1	14.4	0.34	14.74	30	Pass
NVNT	ac20	5200	Ant2	14.03	0.34	14.37	30	Pass
NVNT	ac20	5200	Sum	17.23	0.34	17.57	30	Pass
NVNT	ac20	5240	Ant1	14.38	0.34	14.72	30	Pass
NVNT	ac20	5240	Ant2	13.84	0.34	14.18	30	Pass
NVNT	ac20	5240	Sum	17.13	0.34	17.47	30	Pass
NVNT	ac20	5260	Ant1	14.5	0.34	14.84	24	Pass

NVNT	ac20	5260	Ant2	14.14	0.34	14.48	24	Pass
NVNT	ac20	5260	Sum	17.33	0.34	17.67	24	Pass
NVNT	ac20	5300	Ant1	14.33	0.34	14.67	24	Pass
NVNT	ac20	5300	Ant2	13.91	0.34	14.25	24	Pass
NVNT	ac20	5300	Sum	17.14	0.34	17.48	24	Pass
NVNT	ac20	5320	Ant1	14.29	0.34	14.63	24	Pass
NVNT	ac20	5320	Ant2	13.91	0.34	14.25	24	Pass
NVNT	ac20	5320	Sum	17.11	0.34	17.45	24	Pass
NVNT	ac20	5500	Ant1	13.62	0.34	13.96	24	Pass
NVNT	ac20	5500	Ant2	12.55	0.34	12.89	24	Pass
NVNT	ac20	5500	Sum	16.13	0.34	16.47	24	Pass
NVNT	ac20	5580	Ant1	12.34	0.34	12.68	24	Pass
NVNT	ac20	5580	Ant2	12.45	0.34	12.79	24	Pass
NVNT	ac20	5580	Sum	15.41	0.34	15.75	24	Pass
NVNT	ac20	5700	Ant1	12.83	0.34	13.17	24	Pass
NVNT	ac20	5700	Ant2	13.95	0.34	14.29	24	Pass
NVNT	ac20	5700	Sum	16.44	0.34	16.78	24	Pass
NVNT	ac20	5745	Ant1	12.88	0.34	13.22	30	Pass
NVNT	ac20	5745	Ant2	14.24	0.34	14.58	30	Pass
NVNT	ac20	5745	Sum	16.62	0.34	16.96	30	Pass
NVNT	ac20	5785	Ant1	13.16	0.34	13.5	30	Pass
NVNT	ac20	5785	Ant2	14.5	0.34	14.84	30	Pass
NVNT	ac20	5785	Sum	16.89	0.34	17.23	30	Pass
NVNT	ac20	5825	Ant1	12.96	0.34	13.3	30	Pass
NVNT	ac20	5825	Ant2	14.85	0.34	15.19	30	Pass
NVNT	ac20	5825	Sum	17.02	0.34	17.36	30	Pass
NVNT	ac40	5190	Ant1	12.98	1.79	14.77	30	Pass
NVNT	ac40	5230	Ant1	12.9	1.79	14.69	30	Pass
NVNT	ac40	5270	Ant1	12.76	1.78	14.54	24	Pass
NVNT	ac40	5310	Ant1	12.88	1.78	14.66	24	Pass
NVNT	ac40	5510	Ant1	14.94	1.79	16.73	24	Pass
NVNT	ac40	5550	Ant1	14.39	1.78	16.17	24	Pass
NVNT	ac40	5670	Ant1	14.12	1.78	15.9	24	Pass
NVNT	ac40	5755	Ant1	12.16	1.78	13.94	30	Pass
NVNT	ac40	5795	Ant1	12.29	1.78	14.07	30	Pass
NVNT	ac40	5190	Ant2	12.92	1.78	14.7	30	Pass
NVNT	ac40	5230	Ant2	12.57	1.78	14.35	30	Pass
NVNT	ac40	5270	Ant2	12.42	1.78	14.2	24	Pass
NVNT	ac40	5310	Ant2	12.33	1.78	14.11	24	Pass
NVNT	ac40	5510	Ant2	11.34	1.78	13.12	24	Pass
NVNT	ac40	5550	Ant2	11.26	1.78	13.04	24	Pass
NVNT	ac40	5670	Ant2	11.55	1.78	13.33	24	Pass
NVNT	ac40	5755	Ant2	11.69	1.79	13.48	30	Pass
NVNT	ac40	5795	Ant2	12.03	1.78	13.81	30	Pass
NVNT	ac40	5190	Ant1	13.94	0.63	14.57	30	Pass
NVNT	ac40	5190	Ant2	13.82	0.63	14.45	30	Pass
NVNT	ac40	5190	Sum	16.89	0.63	17.52	30	Pass
NVNT	ac40	5230	Ant1	14.05	0.63	14.68	30	Pass
NVNT	ac40	5230	Ant2	13.55	0.63	14.18	30	Pass
NVNT	ac40	5230	Sum	16.82	0.63	17.45	30	Pass
NVNT	ac40	5270	Ant1	13.95	0.63	14.58	24	Pass
NVNT	ac40	5270	Ant2	13.5	0.63	14.13	24	Pass
NVNT	ac40	5270	Sum	16.74	0.63	17.37	24	Pass
NVNT	ac40	5310	Ant1	13.83	0.63	14.46	24	Pass
NVNT	ac40	5310	Ant2	13.47	0.63	14.1	24	Pass
NVNT	ac40	5310	Sum	16.66	0.63	17.29	24	Pass

NVNT	ac40	5510	Ant1	13.28	0.63	13.91	24	Pass
NVNT	ac40	5510	Ant2	12.36	0.63	12.99	24	Pass
NVNT	ac40	5510	Sum	15.85	0.63	16.48	24	Pass
NVNT	ac40	5550	Ant1	12.7	0.63	13.33	24	Pass
NVNT	ac40	5550	Ant2	12.39	0.63	13.02	24	Pass
NVNT	ac40	5550	Sum	15.56	0.63	16.19	24	Pass
NVNT	ac40	5670	Ant1	13.57	0.63	14.2	24	Pass
NVNT	ac40	5670	Ant2	13.67	0.63	14.3	24	Pass
NVNT	ac40	5670	Sum	16.63	0.63	17.26	24	Pass
NVNT	ac40	5755	Ant1	12.57	0.63	13.2	30	Pass
NVNT	ac40	5755	Ant2	13.76	0.63	14.39	30	Pass
NVNT	ac40	5755	Sum	16.22	0.63	16.85	30	Pass
NVNT	ac40	5795	Ant1	12.8	0.63	13.43	30	Pass
NVNT	ac40	5795	Ant2	14.2	0.63	14.83	30	Pass
NVNT	ac40	5795	Sum	16.57	0.63	17.2	30	Pass
NVNT	ac80	5210	Ant1	11.64	2.46	14.1	30	Pass
NVNT	ac80	5290	Ant1	11.63	2.46	14.09	24	Pass
NVNT	ac80	5530	Ant1	13.47	2.46	15.93	24	Pass
NVNT	ac80	5610	Ant1	12.79	2.44	15.23	24	Pass
NVNT	ac80	5775	Ant1	11.06	2.46	13.52	30	Pass
NVNT	ac80	5210	Ant2	11.55	2.44	13.99	30	Pass
NVNT	ac80	5290	Ant2	11.25	2.44	13.69	24	Pass
NVNT	ac80	5530	Ant2	9.96	2.44	12.4	24	Pass
NVNT	ac80	5610	Ant2	10.31	2.44	12.75	24	Pass
NVNT	ac80	5775	Ant2	10.81	2.44	13.25	30	Pass
NVNT	ac80	5210	Ant1	12.5	1.12	13.62	30	Pass
NVNT	ac80	5210	Ant2	12.28	1.12	13.4	30	Pass
NVNT	ac80	5210	Sum	15.4	1.12	16.52	30	Pass
NVNT	ac80	5290	Ant1	12.8	1.12	13.92	24	Pass
NVNT	ac80	5290	Ant2	12.38	1.12	13.5	24	Pass
NVNT	ac80	5290	Sum	15.61	1.12	16.73	24	Pass
NVNT	ac80	5530	Ant1	12.92	1.12	14.04	24	Pass
NVNT	ac80	5530	Ant2	12.3	1.12	13.42	24	Pass
NVNT	ac80	5530	Sum	15.63	1.12	16.75	24	Pass
NVNT	ac80	5610	Ant1	12.27	1.12	13.39	24	Pass
NVNT	ac80	5610	Ant2	12.47	1.12	13.59	24	Pass
NVNT	ac80	5610	Sum	15.38	1.12	16.5	24	Pass
NVNT	ac80	5775	Ant1	11.58	1.12	12.7	30	Pass
NVNT	ac80	5775	Ant2	12.91	1.12	14.03	30	Pass
NVNT	ac80	5775	Sum	15.31	1.12	16.43	30	Pass
NVNT	ac160	5250	Ant1	9.54	3.09	12.63	30	Pass
NVNT	ac160	5570	Ant1	5.95	3.09	9.04	24	Pass
NVNT	ac160	5250	Ant2	9.31	3.15	12.46	30	Pass
NVNT	ac160	5570	Ant2	5.58	3.13	8.71	24	Pass
NVNT	ac160	5250	Ant1	10.43	1.69	12.12	30	Pass
NVNT	ac160	5250	Ant2	10.15	1.69	11.84	30	Pass
NVNT	ac160	5250	Sum	13.3	1.69	14.99	30	Pass
NVNT	ac160	5570	Ant1	8.99	1.69	10.68	24	Pass
NVNT	ac160	5570	Ant2	8.51	1.69	10.2	24	Pass
NVNT	ac160	5570	Sum	11.77	1.69	13.46	24	Pass
NVNT	ax20	5180	Ant1	11.29	1.32	12.61	30	Pass
NVNT	ax20	5200	Ant1	11.31	1.32	12.63	30	Pass
NVNT	ax20	5240	Ant1	11.2	1.32	12.52	30	Pass
NVNT	ax20	5260	Ant1	11.25	1.32	12.57	24	Pass
NVNT	ax20	5300	Ant1	11.07	1.32	12.39	24	Pass
NVNT	ax20	5320	Ant1	11.22	1.32	12.54	24	Pass

NVNT	ax20	5500	Ant1	10.56	1.32	11.88	24	Pass
NVNT	ax20	5580	Ant1	9.39	1.32	10.71	24	Pass
NVNT	ax20	5700	Ant1	8.95	1.32	10.27	24	Pass
NVNT	ax20	5745	Ant1	8.81	1.32	10.13	30	Pass
NVNT	ax20	5785	Ant1	9.21	1.32	10.53	30	Pass
NVNT	ax20	5825	Ant1	9.08	1.32	10.4	30	Pass
NVNT	ax20	5180	Ant2	11.39	1.32	12.71	30	Pass
NVNT	ax20	5200	Ant2	11.04	1.32	12.36	30	Pass
NVNT	ax20	5240	Ant2	10.84	1.32	12.16	30	Pass
NVNT	ax20	5260	Ant2	10.98	1.32	12.3	24	Pass
NVNT	ax20	5300	Ant2	10.76	1.32	12.08	24	Pass
NVNT	ax20	5320	Ant2	10.74	1.32	12.06	24	Pass
NVNT	ax20	5500	Ant2	9.42	1.32	10.74	24	Pass
NVNT	ax20	5580	Ant2	9.36	1.32	10.68	24	Pass
NVNT	ax20	5700	Ant2	9.84	1.32	11.16	24	Pass
NVNT	ax20	5745	Ant2	10.22	1.32	11.54	30	Pass
NVNT	ax20	5785	Ant2	10.43	1.32	11.75	30	Pass
NVNT	ax20	5825	Ant2	10.64	1.32	11.96	30	Pass
NVNT	ax20	5180	Ant1	14.19	0.43	14.62	30	Pass
NVNT	ax20	5180	Ant2	14.31	0.43	14.74	30	Pass
NVNT	ax20	5180	Sum	17.26	0.43	17.69	30	Pass
NVNT	ax20	5200	Ant1	14.54	0.43	14.97	30	Pass
NVNT	ax20	5200	Ant2	14.15	0.43	14.58	30	Pass
NVNT	ax20	5200	Sum	17.36	0.43	17.79	30	Pass
NVNT	ax20	5240	Ant1	14.6	0.43	15.03	30	Pass
NVNT	ax20	5240	Ant2	13.88	0.43	14.31	30	Pass
NVNT	ax20	5240	Sum	17.27	0.43	17.7	30	Pass
NVNT	ax20	5260	Ant1	14.62	0.43	15.05	24	Pass
NVNT	ax20	5260	Ant2	14.12	0.43	14.55	24	Pass
NVNT	ax20	5260	Sum	17.39	0.43	17.82	24	Pass
NVNT	ax20	5300	Ant1	14.42	0.43	14.85	24	Pass
NVNT	ax20	5300	Ant2	13.96	0.43	14.39	24	Pass
NVNT	ax20	5300	Sum	17.21	0.43	17.64	24	Pass
NVNT	ax20	5320	Ant1	14.51	0.43	14.94	24	Pass
NVNT	ax20	5320	Ant2	14	0.43	14.43	24	Pass
NVNT	ax20	5320	Sum	17.27	0.43	17.7	24	Pass
NVNT	ax20	5500	Ant1	13.86	0.43	14.29	24	Pass
NVNT	ax20	5500	Ant2	12.68	0.43	13.11	24	Pass
NVNT	ax20	5500	Sum	16.32	0.43	16.75	24	Pass
NVNT	ax20	5580	Ant1	12.5	0.43	12.93	24	Pass
NVNT	ax20	5580	Ant2	12.59	0.43	13.02	24	Pass
NVNT	ax20	5580	Sum	15.56	0.43	15.99	24	Pass
NVNT	ax20	5700	Ant1	12.97	0.43	13.4	24	Pass
NVNT	ax20	5700	Ant2	13.99	0.43	14.42	24	Pass
NVNT	ax20	5700	Sum	16.52	0.43	16.95	24	Pass
NVNT	ax20	5745	Ant1	12.97	0.43	13.4	30	Pass
NVNT	ax20	5745	Ant2	14.31	0.43	14.74	30	Pass
NVNT	ax20	5745	Sum	16.7	0.43	17.13	30	Pass
NVNT	ax20	5785	Ant1	13.15	0.43	13.58	30	Pass
NVNT	ax20	5785	Ant2	14.59	0.43	15.02	30	Pass
NVNT	ax20	5785	Sum	16.94	0.43	17.37	30	Pass
NVNT	ax20	5825	Ant1	13.02	0.43	13.45	30	Pass
NVNT	ax20	5825	Ant2	14.95	0.43	15.38	30	Pass
NVNT	ax20	5825	Sum	17.1	0.43	17.53	30	Pass
NVNT	ax40	5190	Ant1	10.76	1.8	12.56	30	Pass
NVNT	ax40	5230	Ant1	10.57	1.82	12.39	30	Pass

NVNT	ax40	5270	Ant1	10.54	1.8	12.34	24	Pass
NVNT	ax40	5310	Ant1	10.64	1.81	12.45	24	Pass
NVNT	ax40	5510	Ant1	10.09	1.82	11.91	24	Pass
NVNT	ax40	5550	Ant1	9.54	1.82	11.36	24	Pass
NVNT	ax40	5670	Ant1	9.23	1.8	11.03	24	Pass
NVNT	ax40	5755	Ant1	8.41	1.81	10.22	30	Pass
NVNT	ax40	5795	Ant1	8.54	1.82	10.36	30	Pass
NVNT	ax40	5190	Ant2	10.73	1.82	12.55	30	Pass
NVNT	ax40	5230	Ant2	10.3	1.82	12.12	30	Pass
NVNT	ax40	5270	Ant2	10.09	1.82	11.91	24	Pass
NVNT	ax40	5310	Ant2	10.12	1.82	11.94	24	Pass
NVNT	ax40	5510	Ant2	9.17	1.82	10.99	24	Pass
NVNT	ax40	5550	Ant2	9.04	1.82	10.86	24	Pass
NVNT	ax40	5670	Ant2	9.29	1.82	11.11	24	Pass
NVNT	ax40	5755	Ant2	9.53	1.82	11.35	30	Pass
NVNT	ax40	5795	Ant2	9.9	1.82	11.72	30	Pass
NVNT	ax40	5190	Ant1	13.98	0.73	14.71	30	Pass
NVNT	ax40	5190	Ant2	13.87	0.73	14.6	30	Pass
NVNT	ax40	5190	Sum	16.94	0.73	17.67	30	Pass
NVNT	ax40	5230	Ant1	14.23	0.74	14.97	30	Pass
NVNT	ax40	5230	Ant2	13.67	0.74	14.41	30	Pass
NVNT	ax40	5230	Sum	16.97	0.74	17.71	30	Pass
NVNT	ax40	5270	Ant1	14.06	0.73	14.79	24	Pass
NVNT	ax40	5270	Ant2	13.68	0.73	14.41	24	Pass
NVNT	ax40	5270	Sum	16.88	0.73	17.61	24	Pass
NVNT	ax40	5310	Ant1	14.06	0.73	14.79	24	Pass
NVNT	ax40	5310	Ant2	13.59	0.73	14.32	24	Pass
NVNT	ax40	5310	Sum	16.84	0.73	17.57	24	Pass
NVNT	ax40	5510	Ant1	13.46	0.73	14.19	24	Pass
NVNT	ax40	5510	Ant2	12.64	0.73	13.37	24	Pass
NVNT	ax40	5510	Sum	16.08	0.73	16.81	24	Pass
NVNT	ax40	5550	Ant1	12.89	0.73	13.62	24	Pass
NVNT	ax40	5550	Ant2	12.57	0.73	13.3	24	Pass
NVNT	ax40	5550	Sum	15.74	0.73	16.47	24	Pass
NVNT	ax40	5670	Ant1	13.66	0.73	14.39	24	Pass
NVNT	ax40	5670	Ant2	13.81	0.73	14.54	24	Pass
NVNT	ax40	5670	Sum	16.75	0.73	17.48	24	Pass
NVNT	ax40	5755	Ant1	12.76	0.73	13.49	30	Pass
NVNT	ax40	5755	Ant2	13.91	0.73	14.64	30	Pass
NVNT	ax40	5755	Sum	16.38	0.73	17.11	30	Pass
NVNT	ax40	5795	Ant1	12.92	0.73	13.65	30	Pass
NVNT	ax40	5795	Ant2	14.31	0.73	15.04	30	Pass
NVNT	ax40	5795	Sum	16.68	0.73	17.41	30	Pass
NVNT	ax80	5210	Ant1	9.65	2.19	11.84	30	Pass
NVNT	ax80	5290	Ant1	9.57	2.18	11.75	24	Pass
NVNT	ax80	5530	Ant1	8.86	2.19	11.05	24	Pass
NVNT	ax80	5610	Ant1	8.14	2.19	10.33	24	Pass
NVNT	ax80	5775	Ant1	7.44	2.18	9.62	30	Pass
NVNT	ax80	5210	Ant2	9.39	2.18	11.57	30	Pass
NVNT	ax80	5290	Ant2	9.16	2.18	11.34	24	Pass
NVNT	ax80	5530	Ant2	8.06	2.19	10.25	24	Pass
NVNT	ax80	5610	Ant2	8.25	2.19	10.44	24	Pass
NVNT	ax80	5775	Ant2	8.87	2.19	11.06	30	Pass
NVNT	ax80	5210	Ant1	12.65	1.2	13.85	30	Pass
NVNT	ax80	5210	Ant2	12.38	1.2	13.58	30	Pass
NVNT	ax80	5210	Sum	15.53	1.2	16.73	30	Pass