





Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

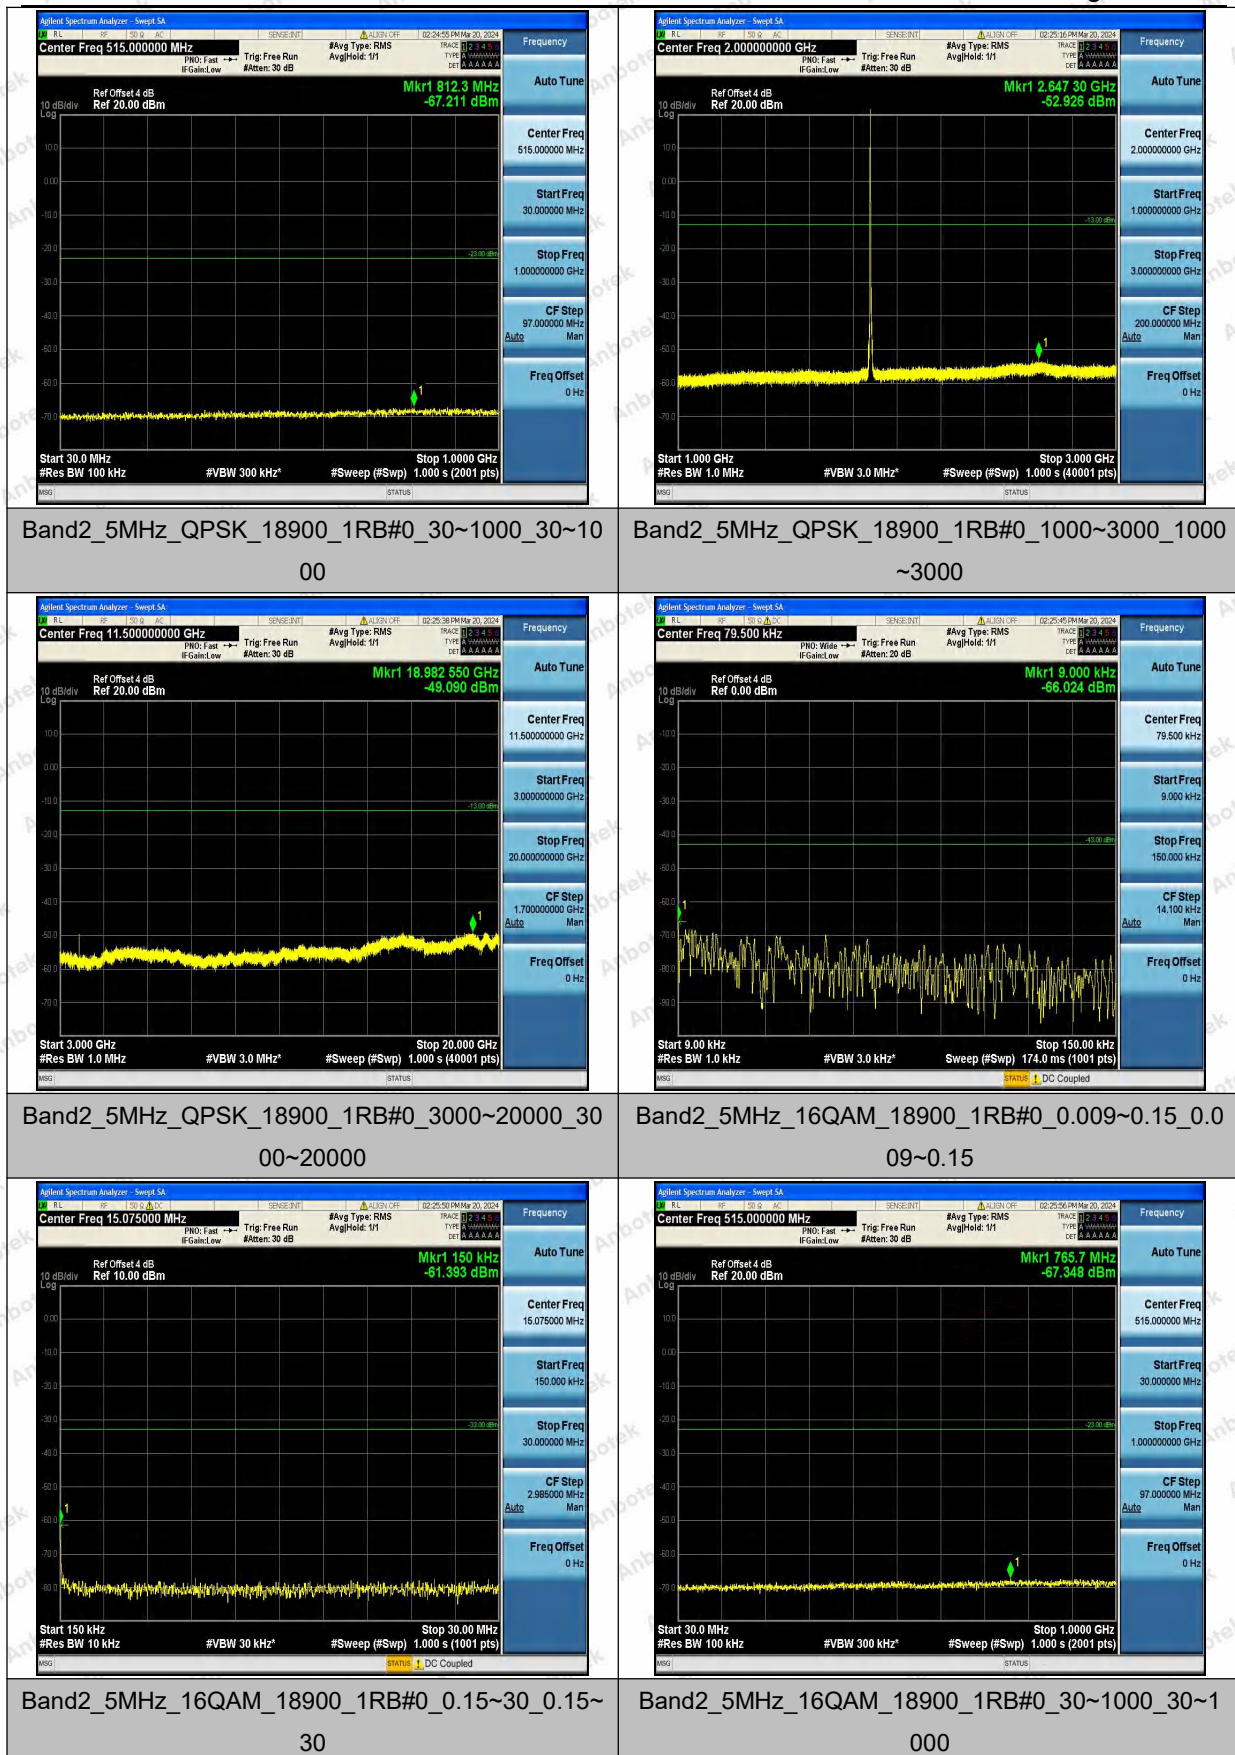

Hotline
 400-003-0500
 www.anbotek.com.cn



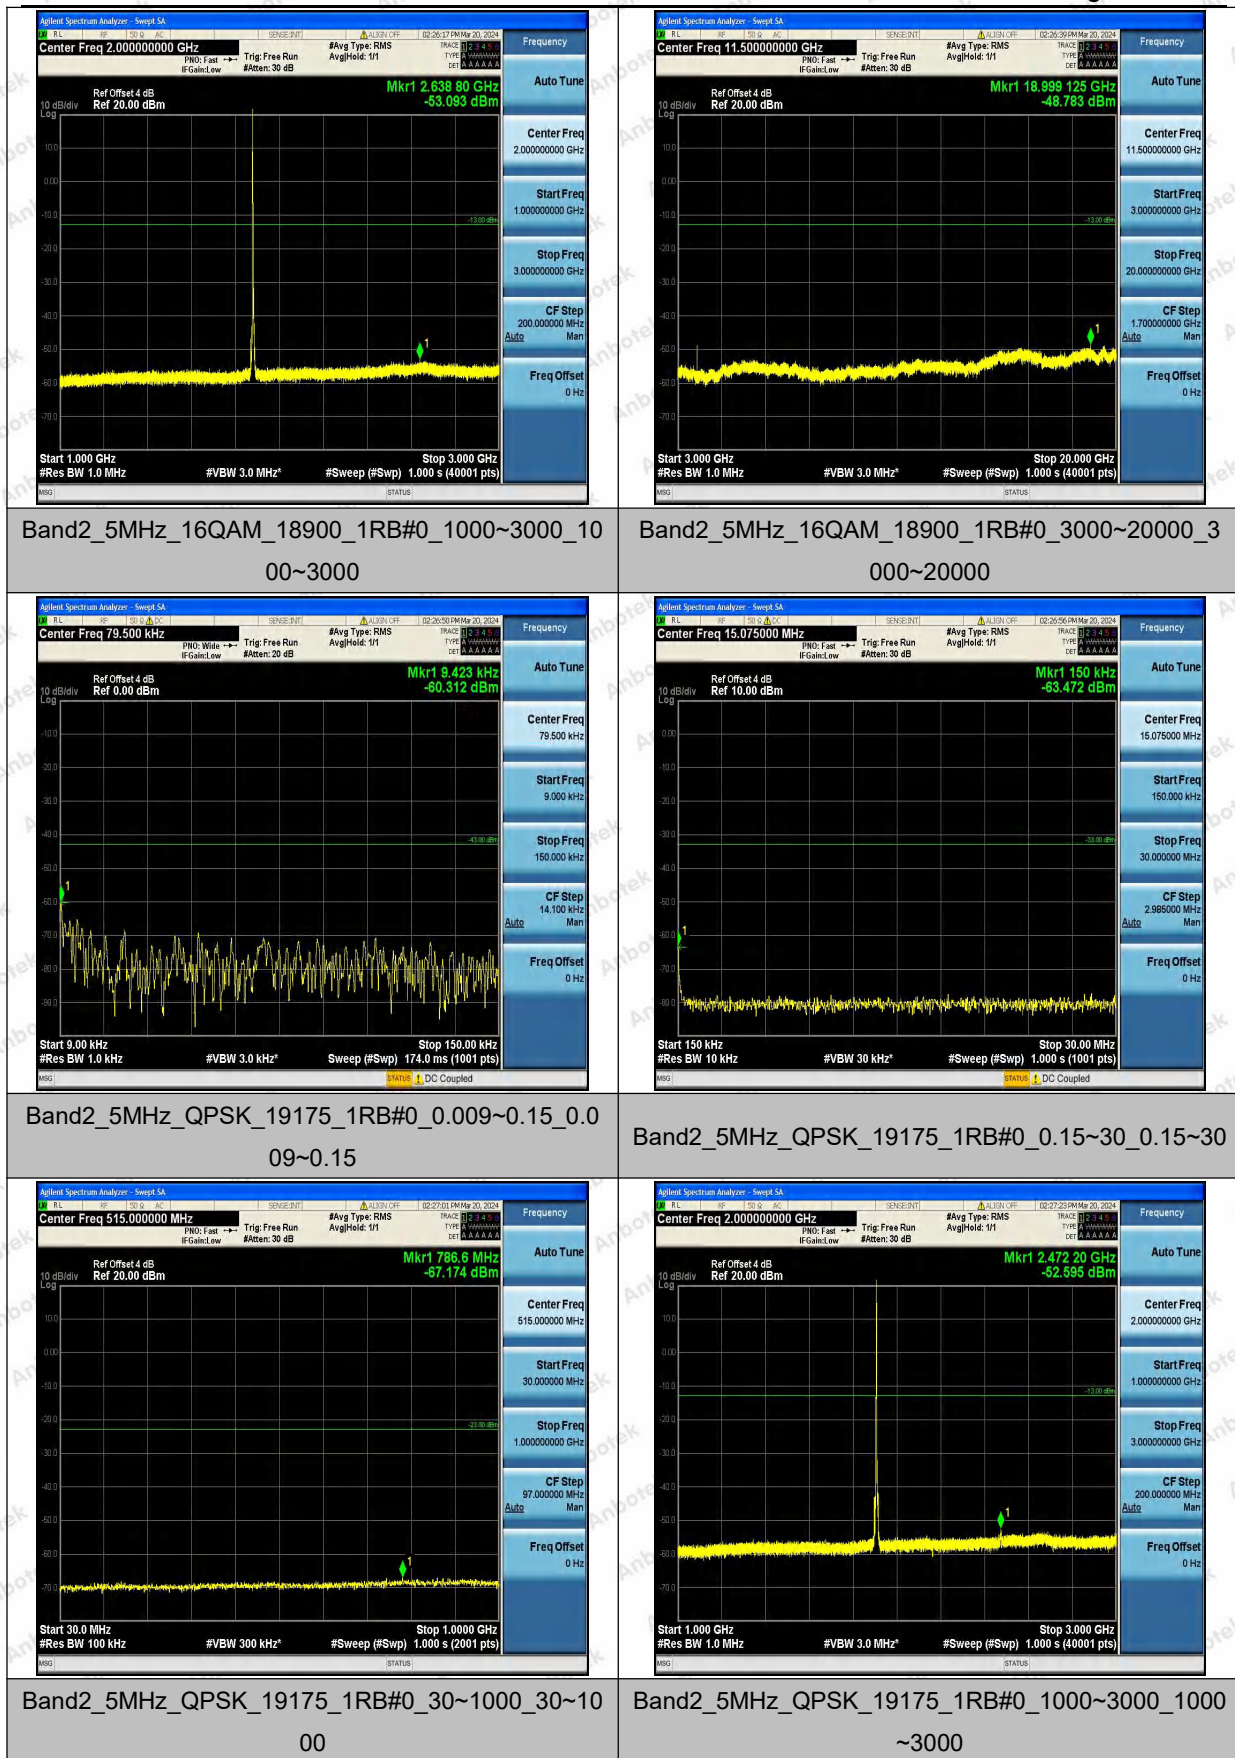


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



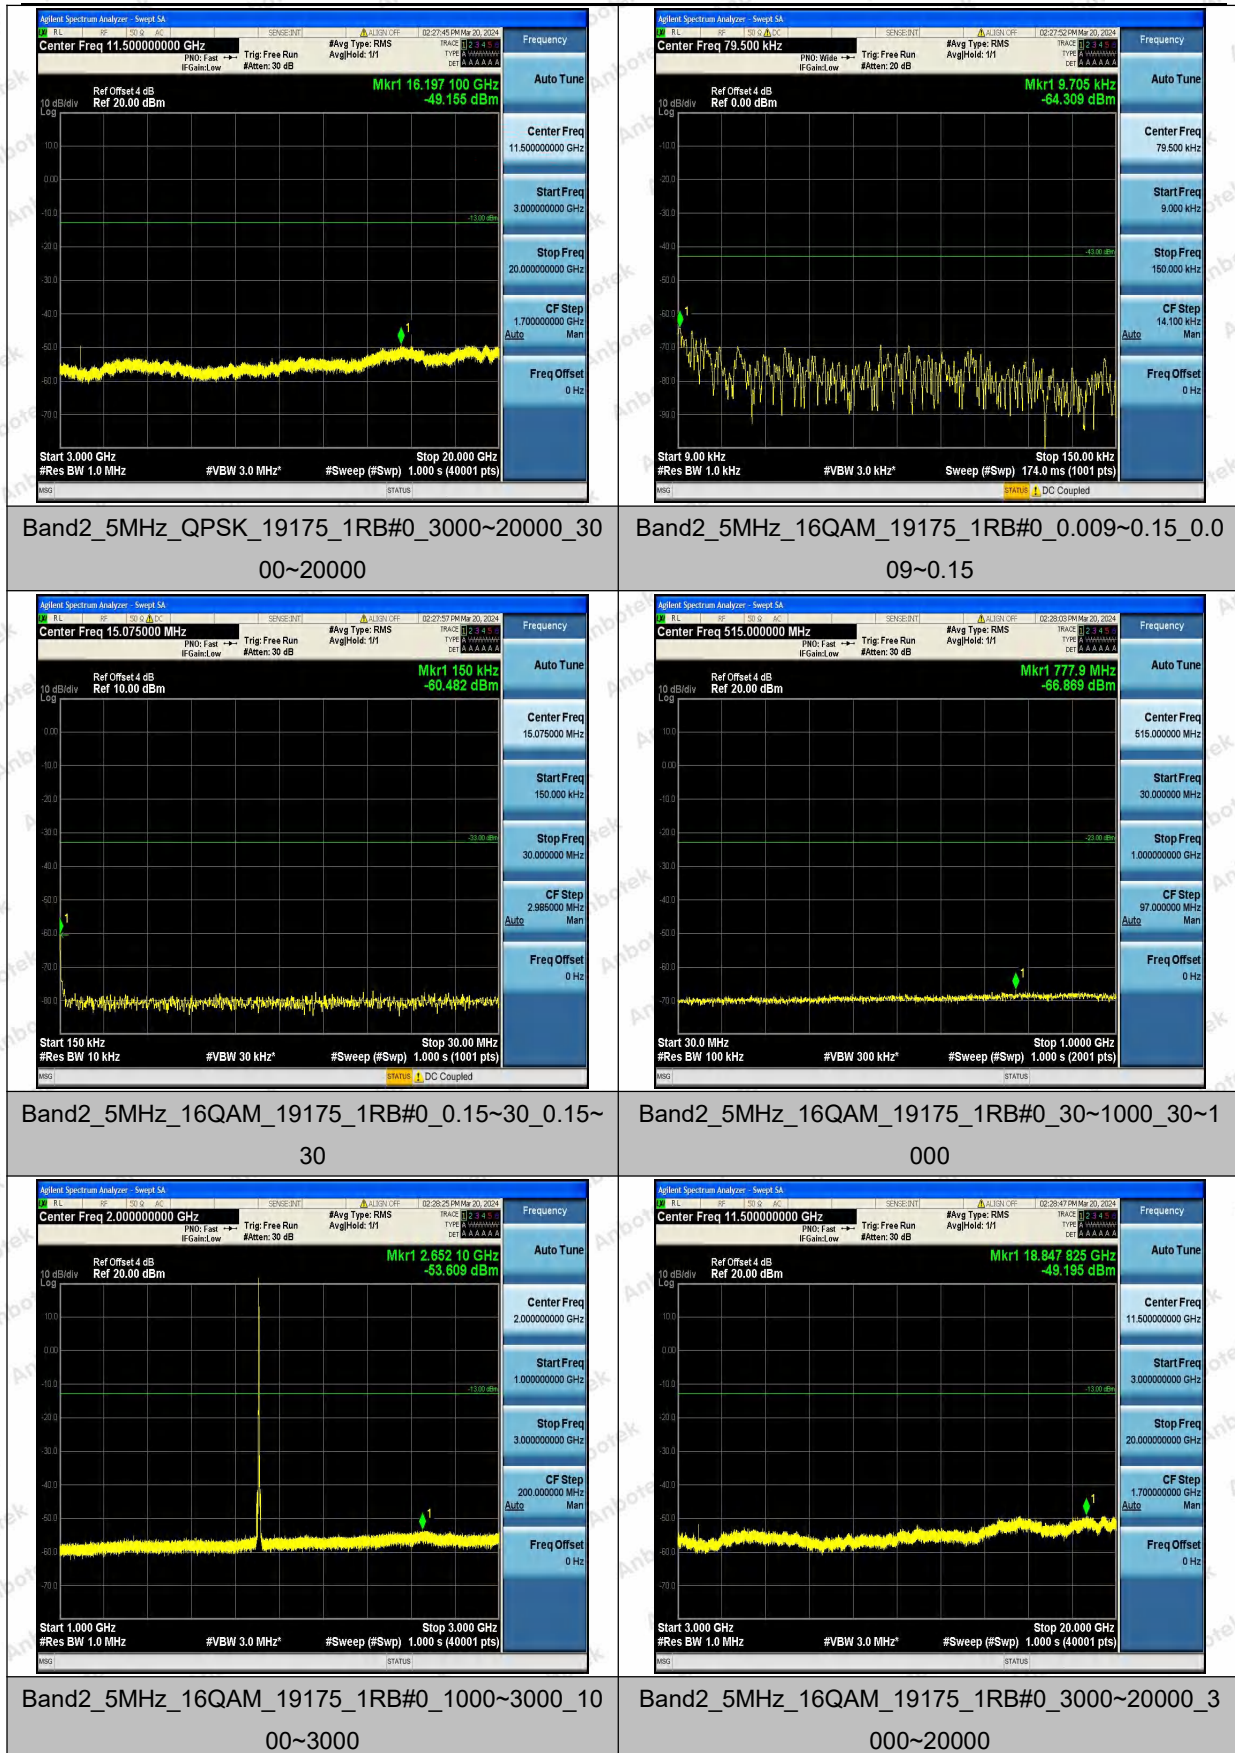



Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500
www.anbotek.com.cn



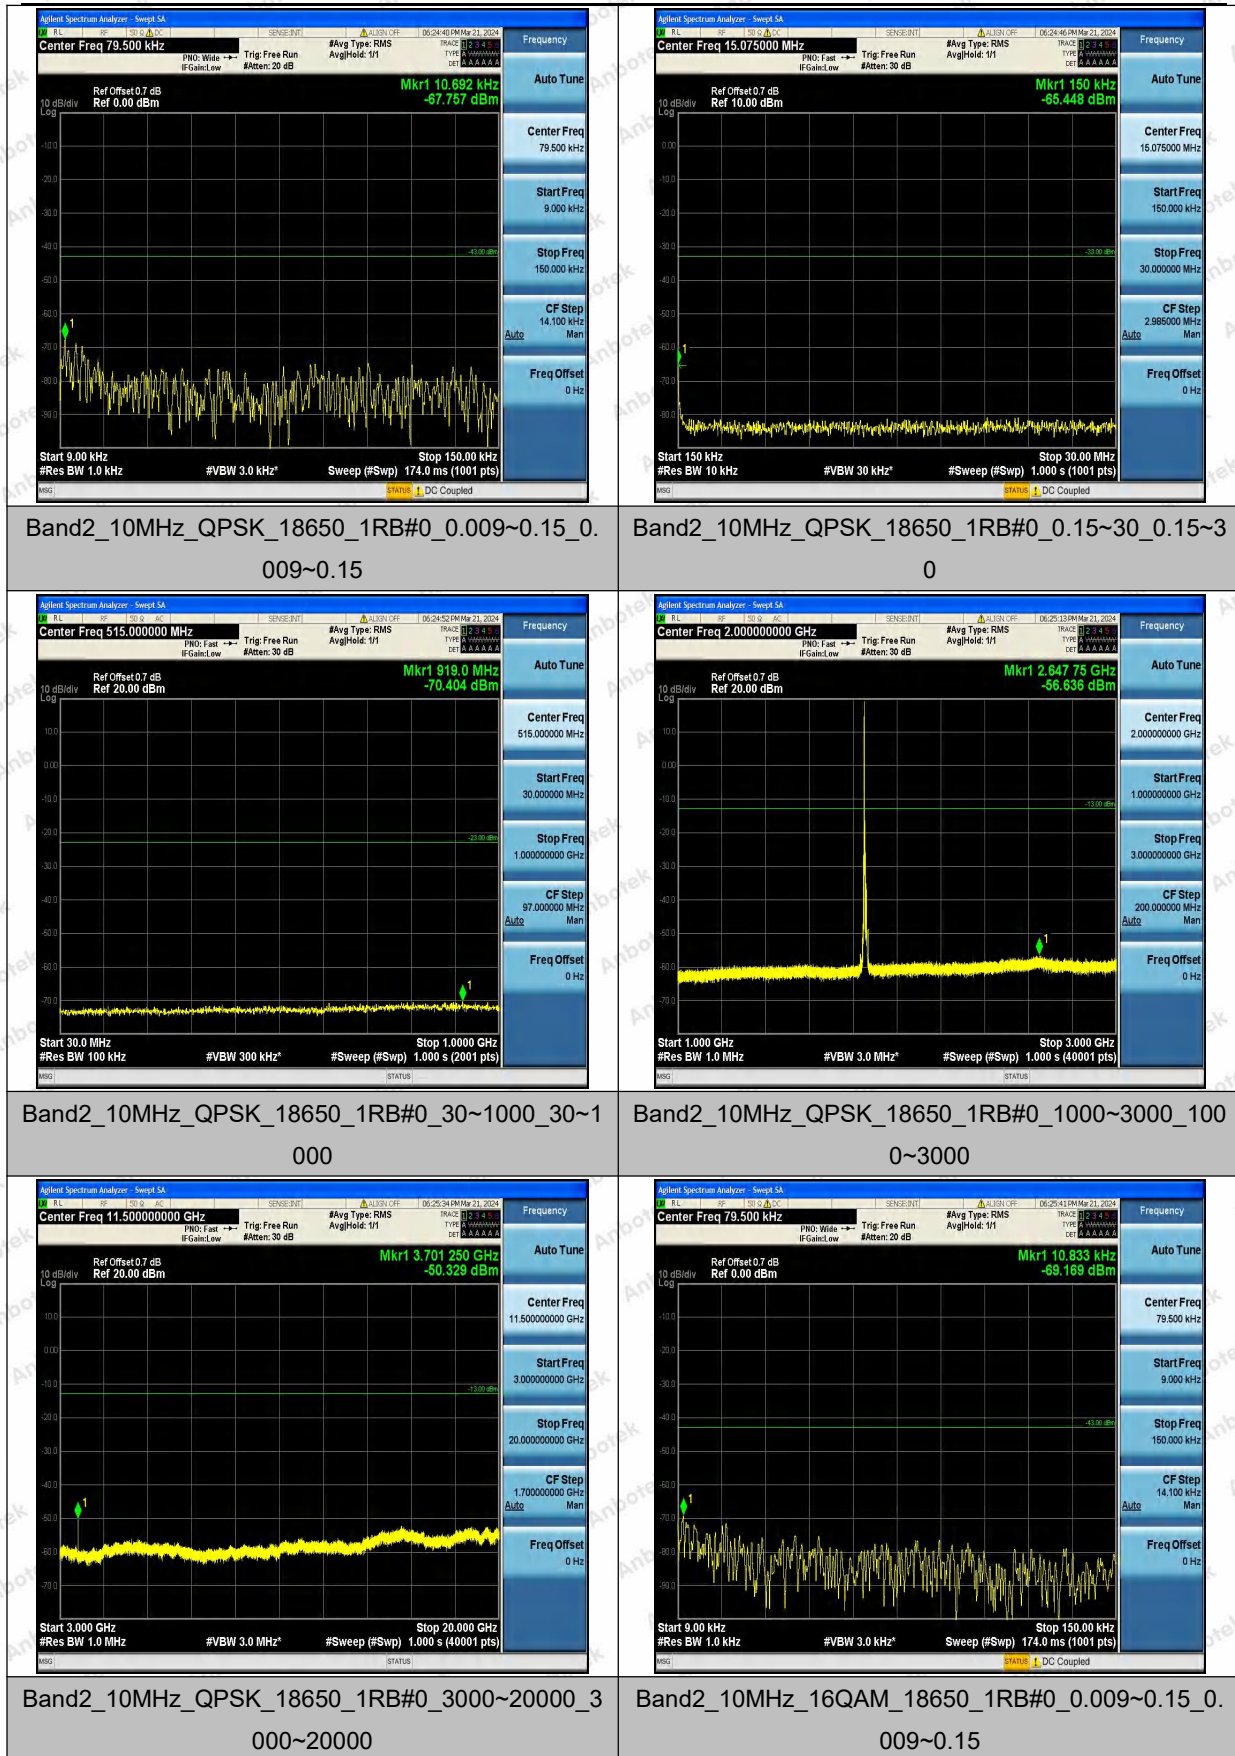

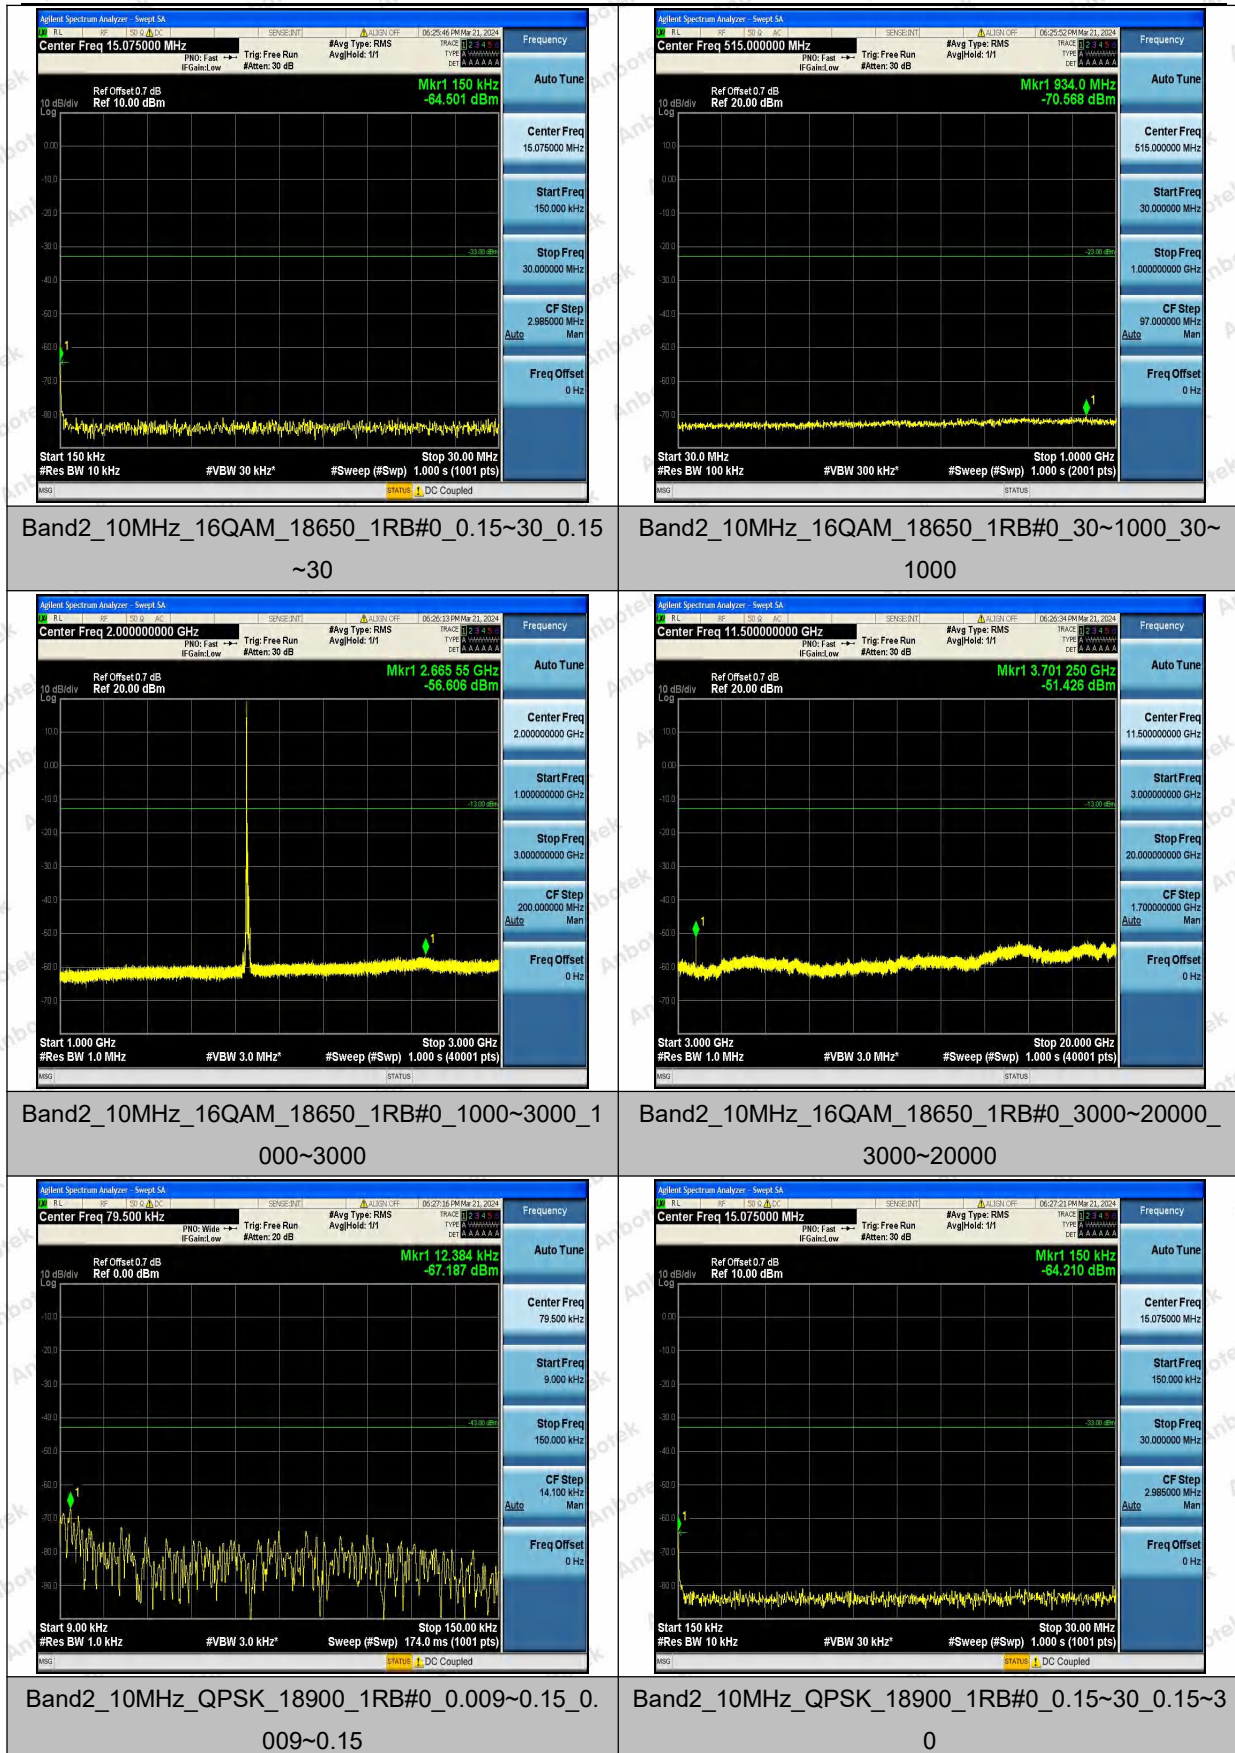


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



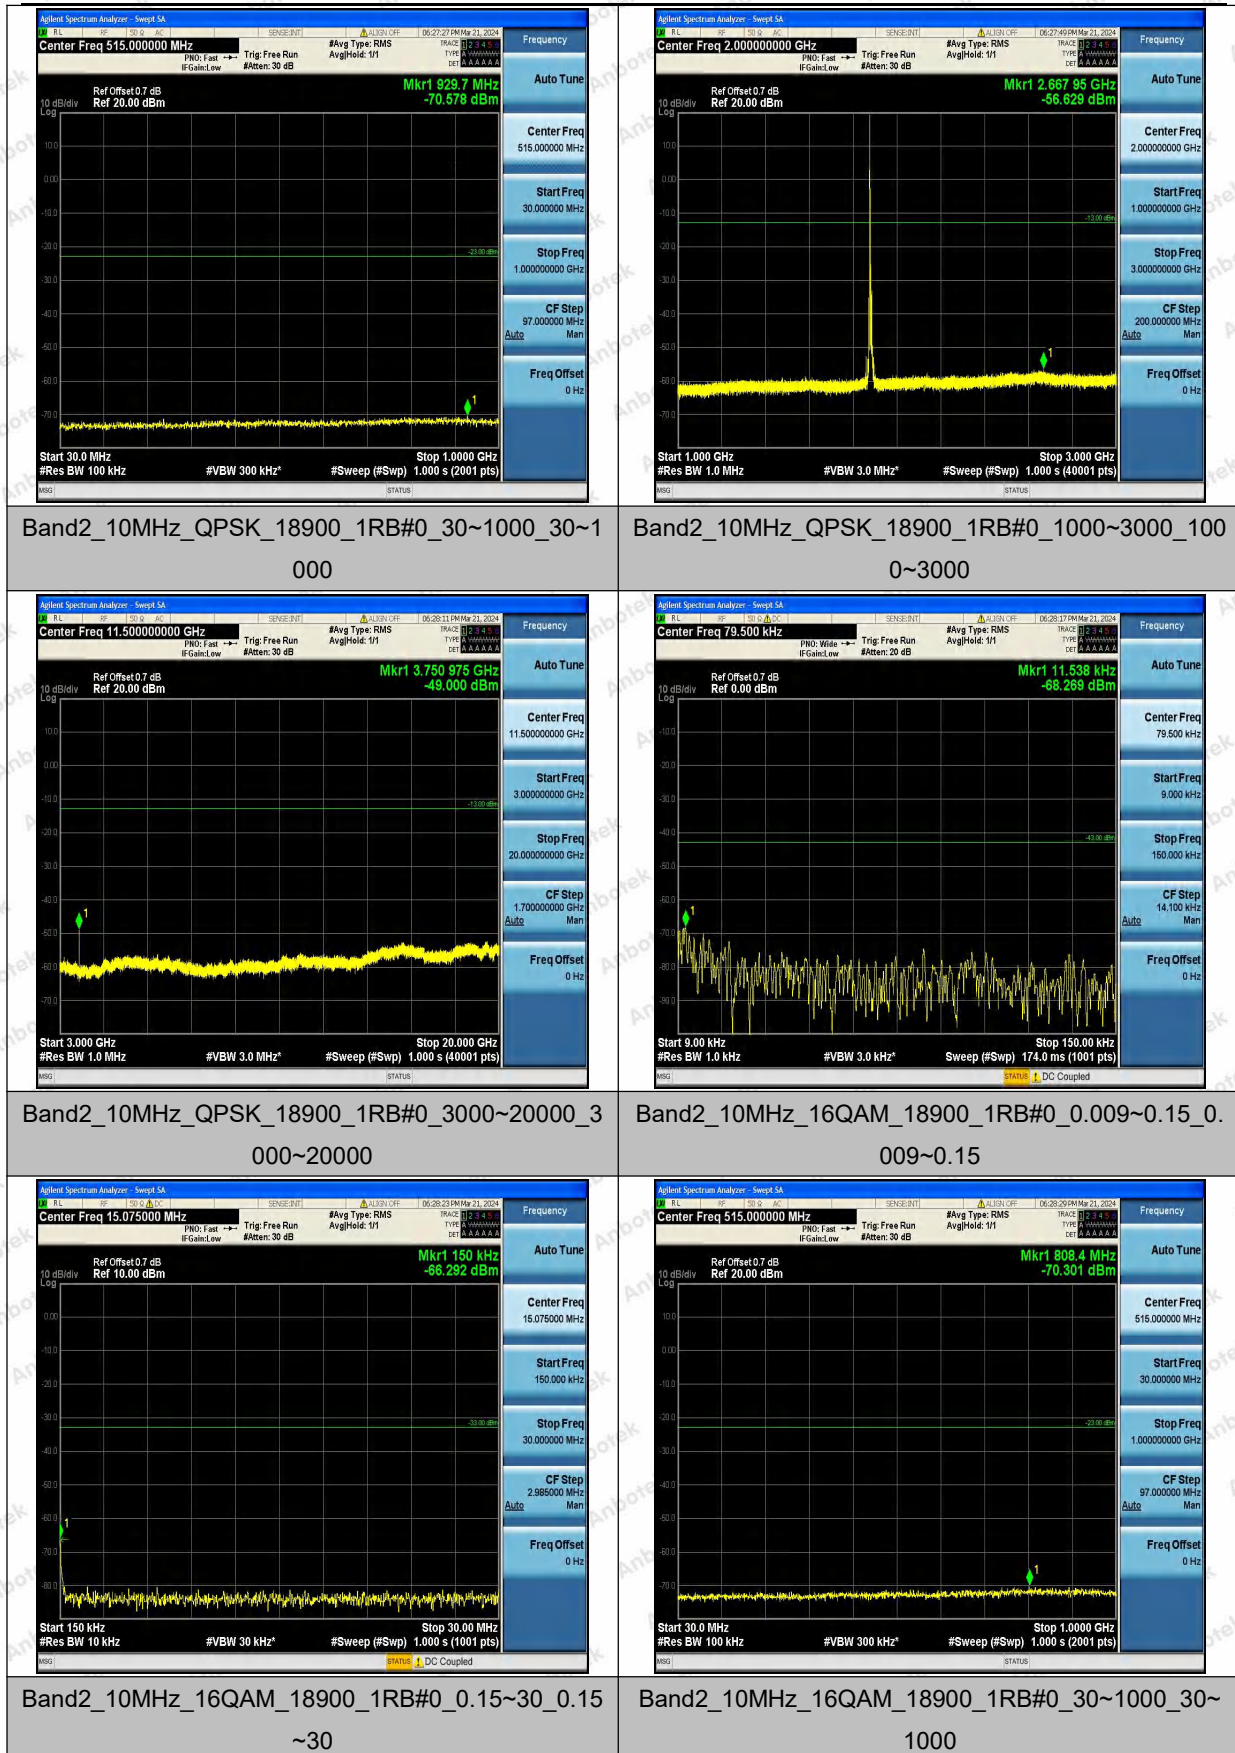


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



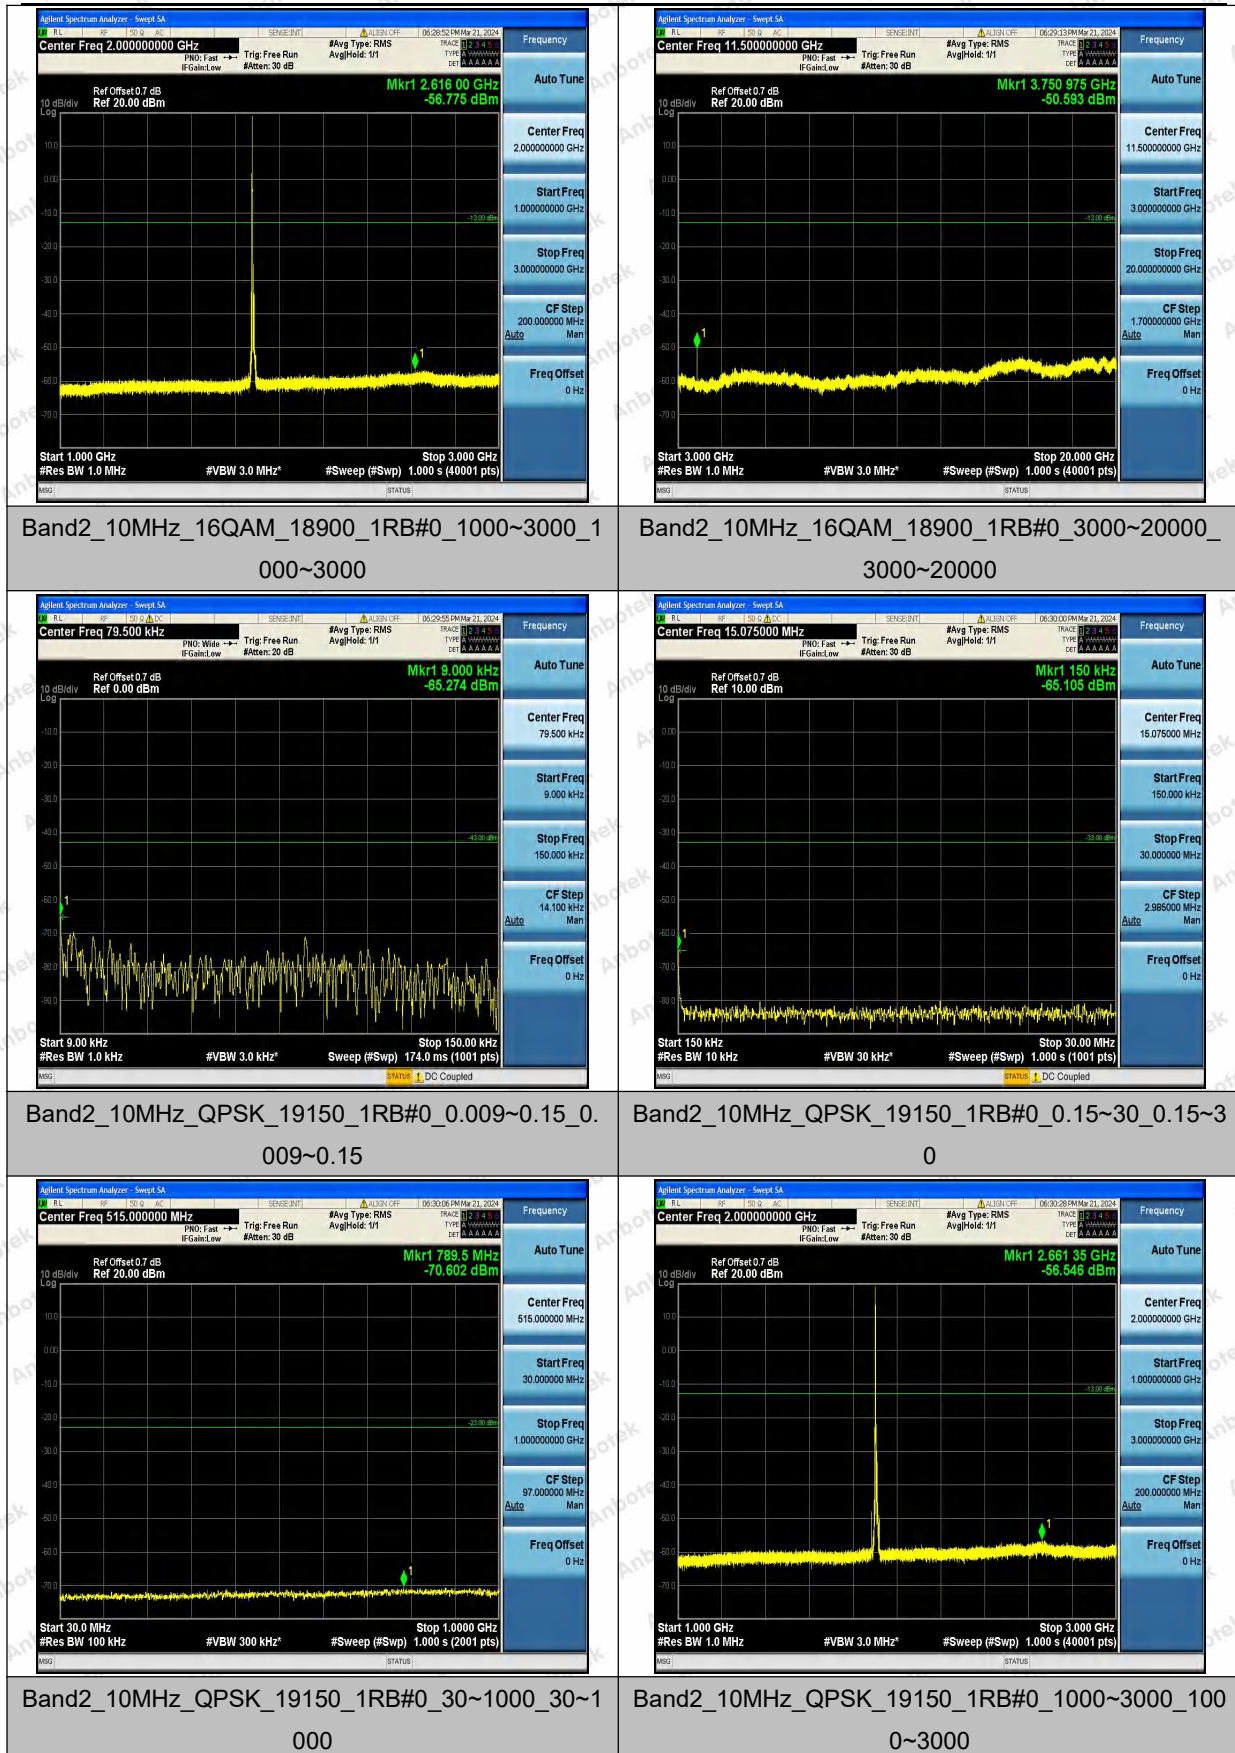


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



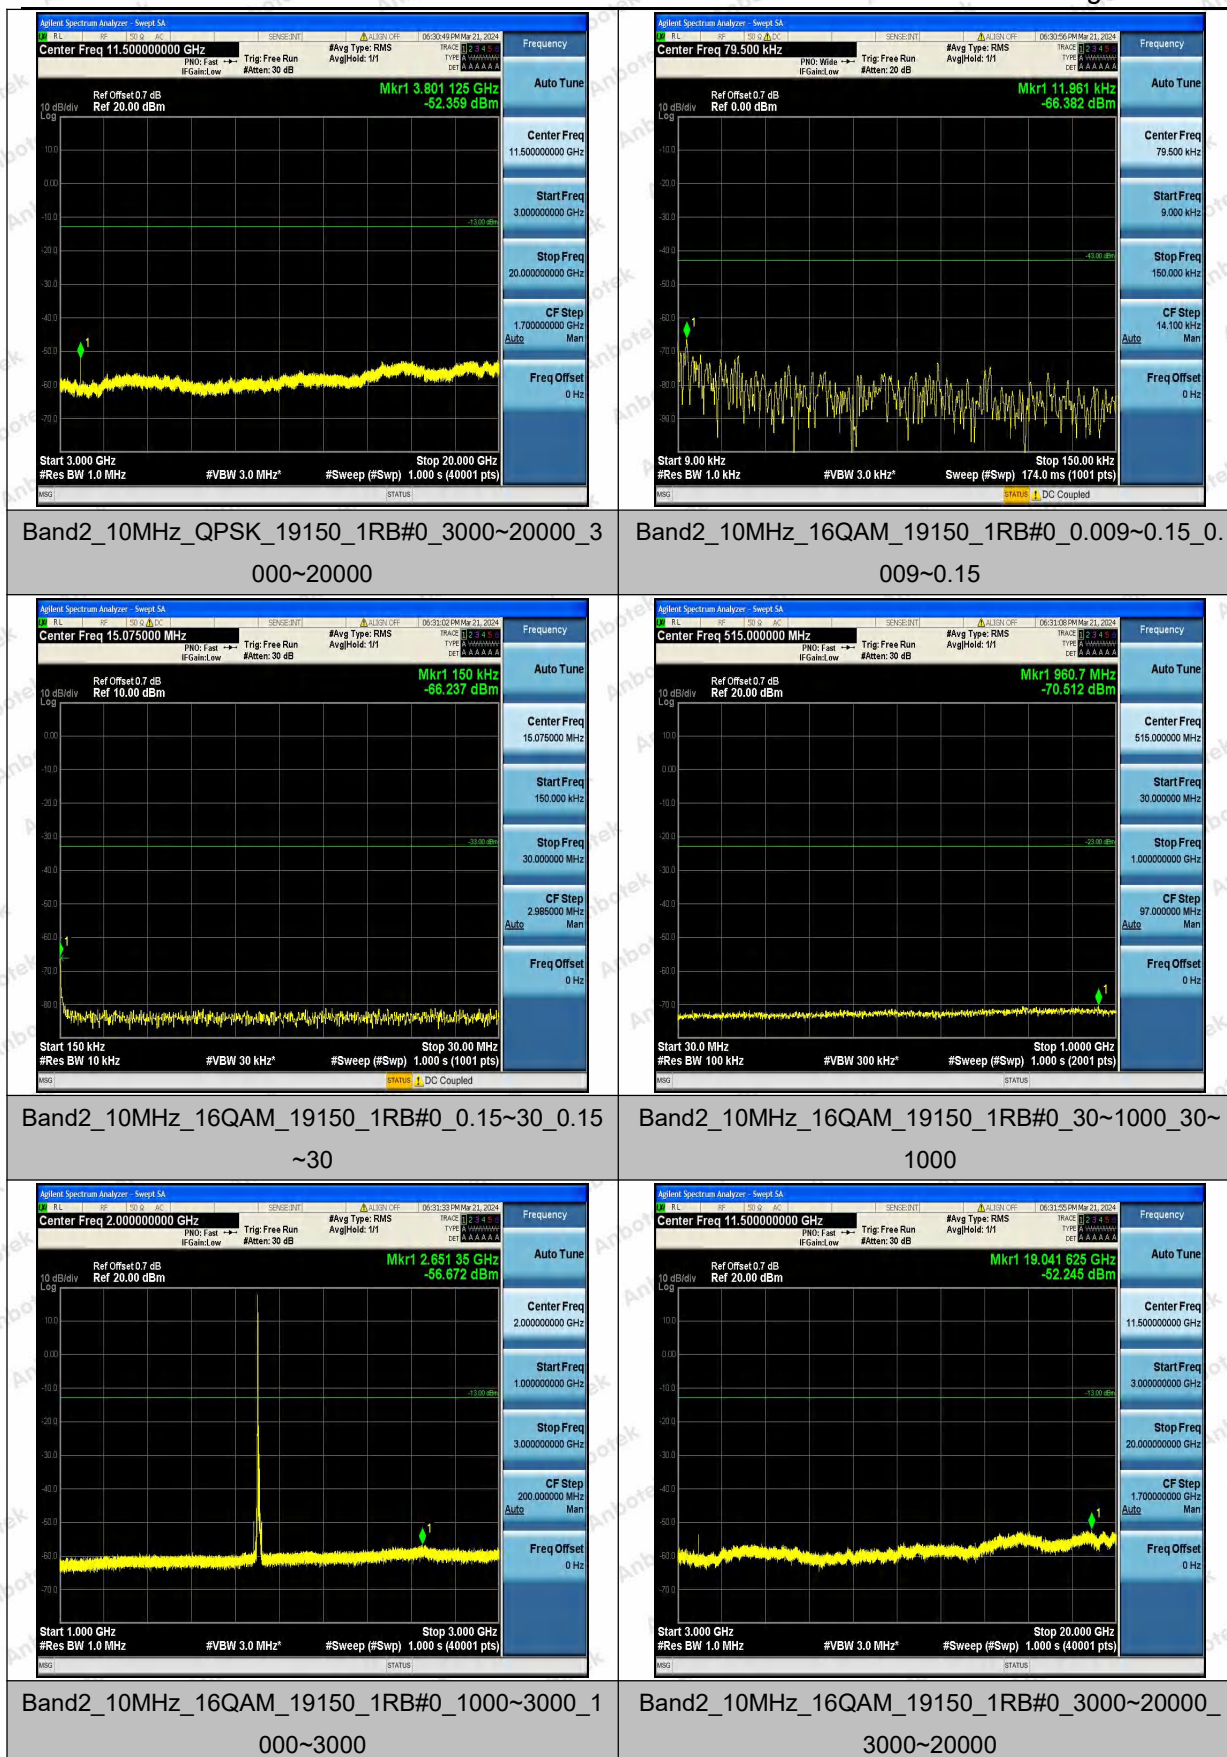


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



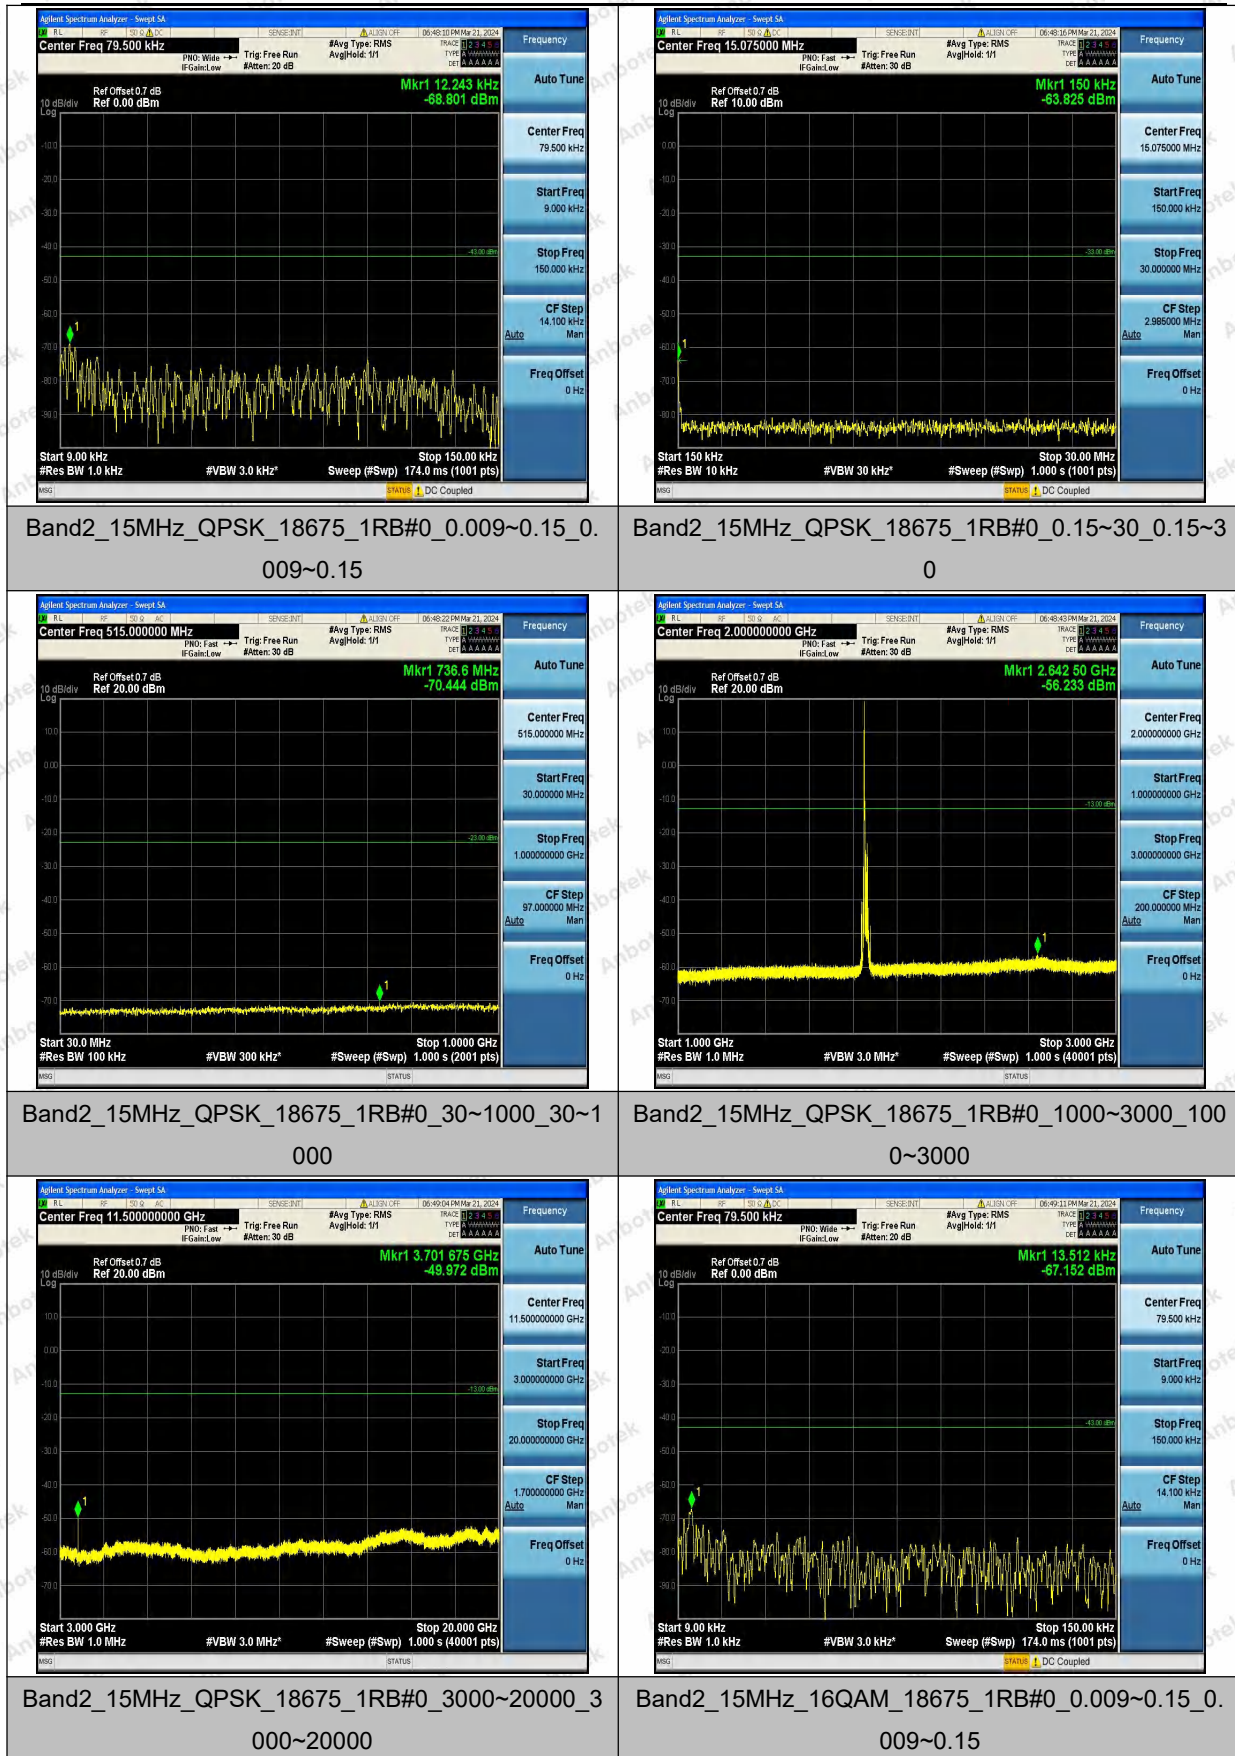


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



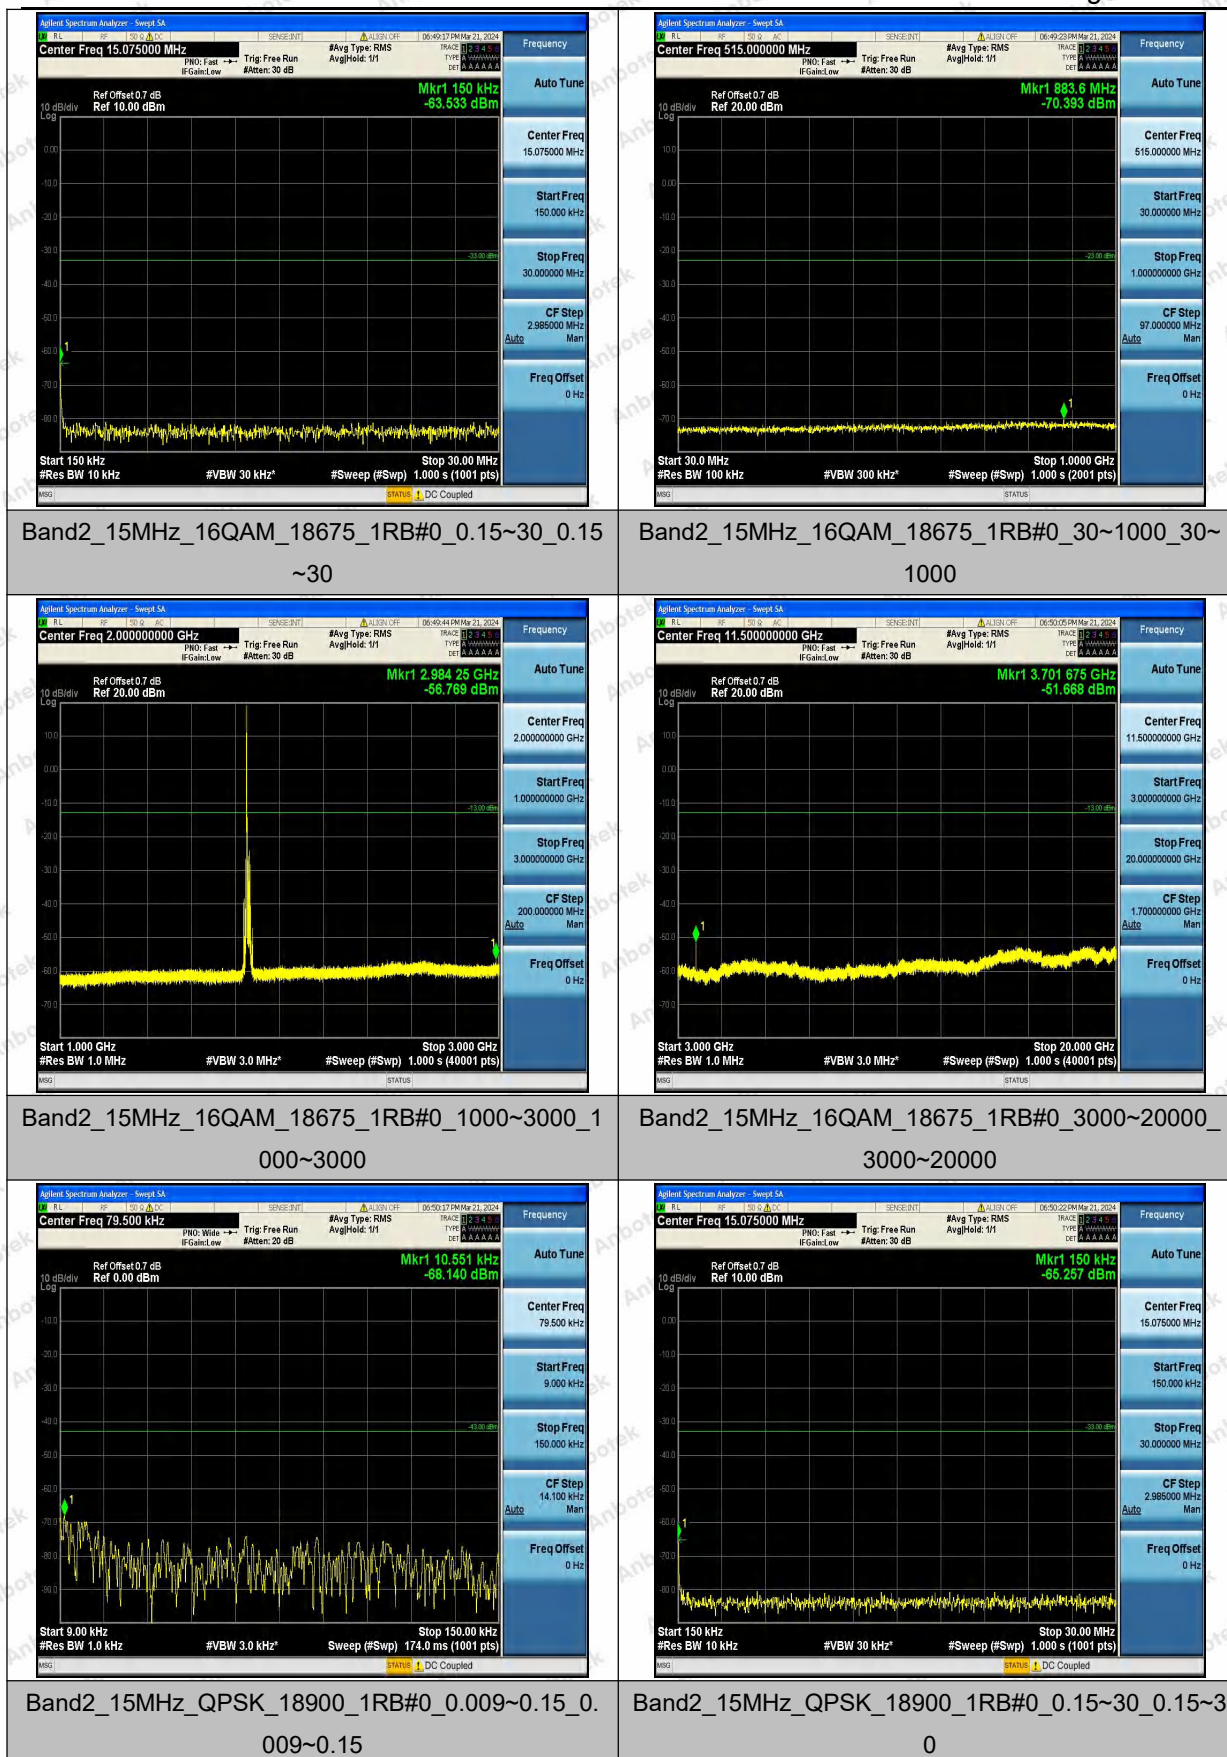


Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



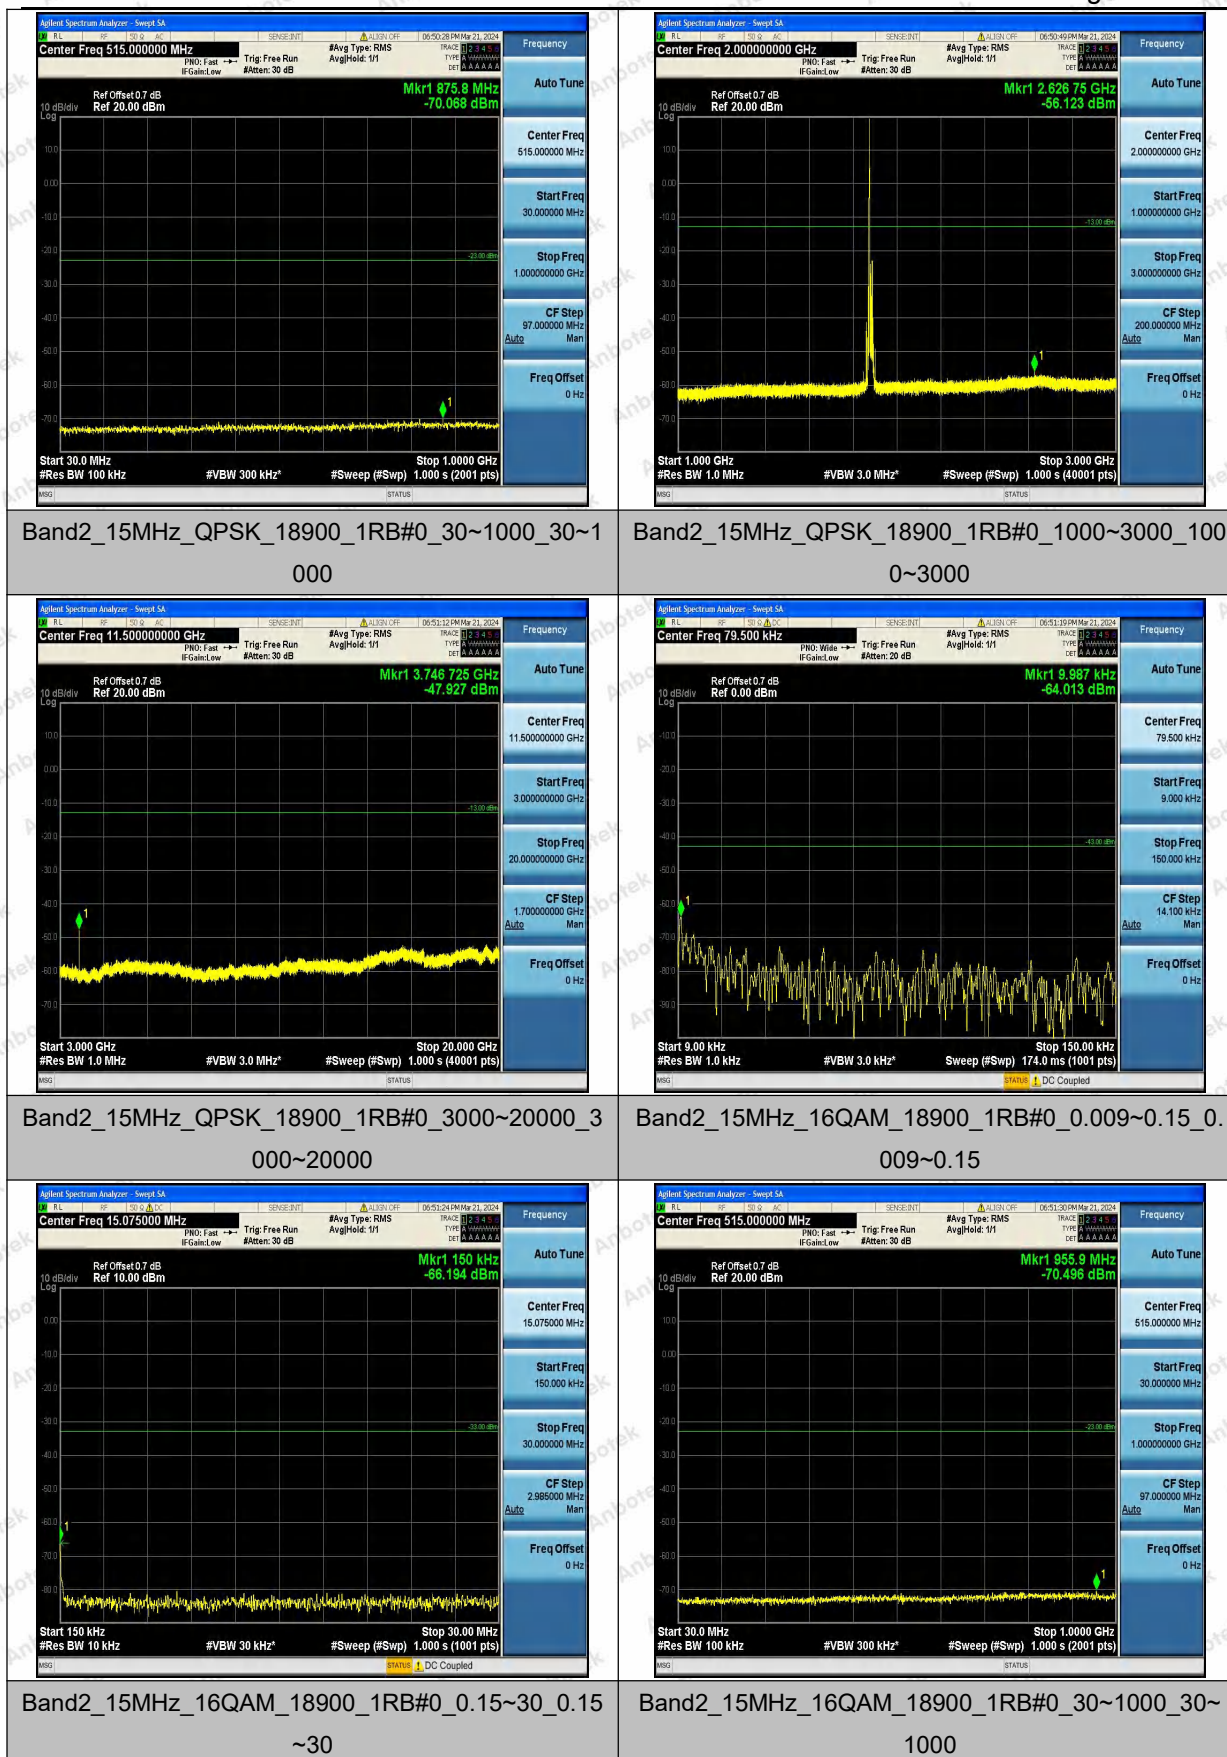

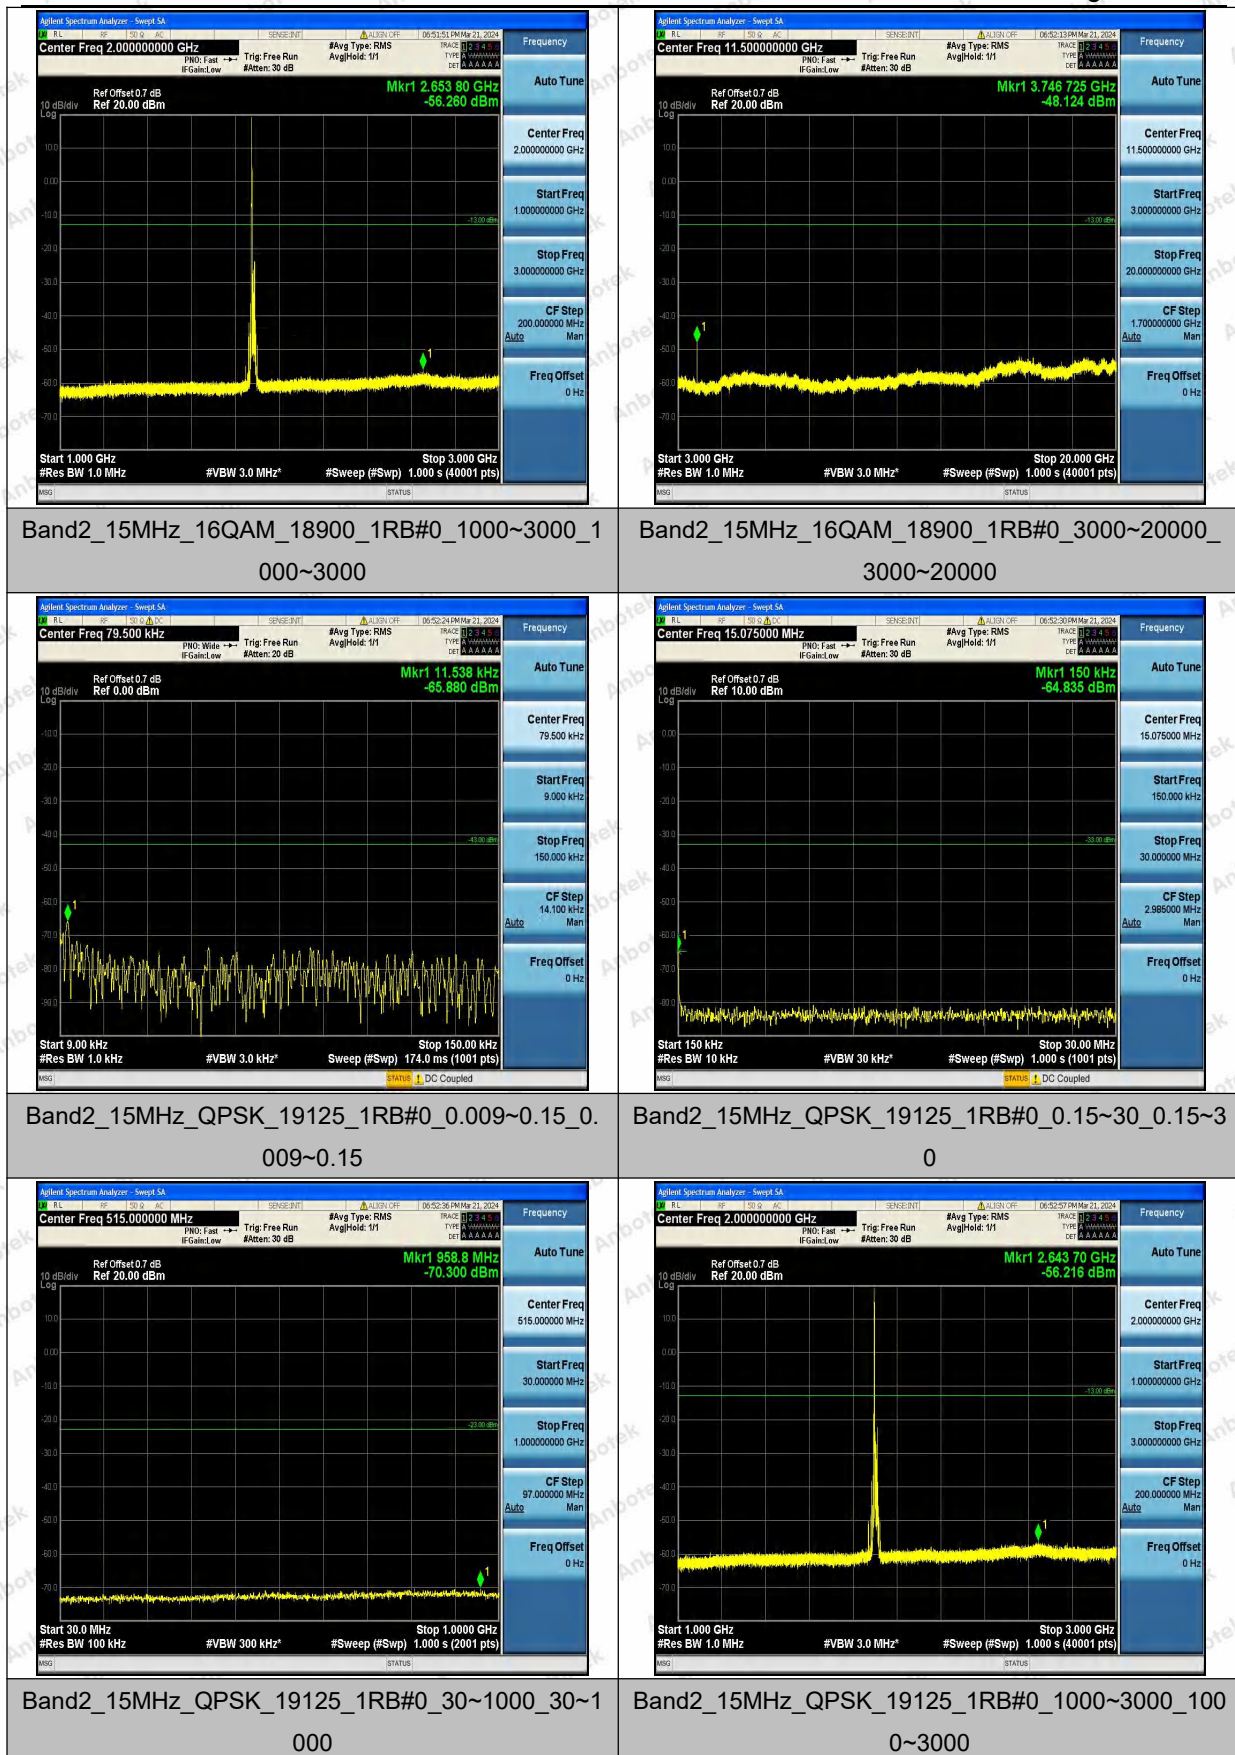


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



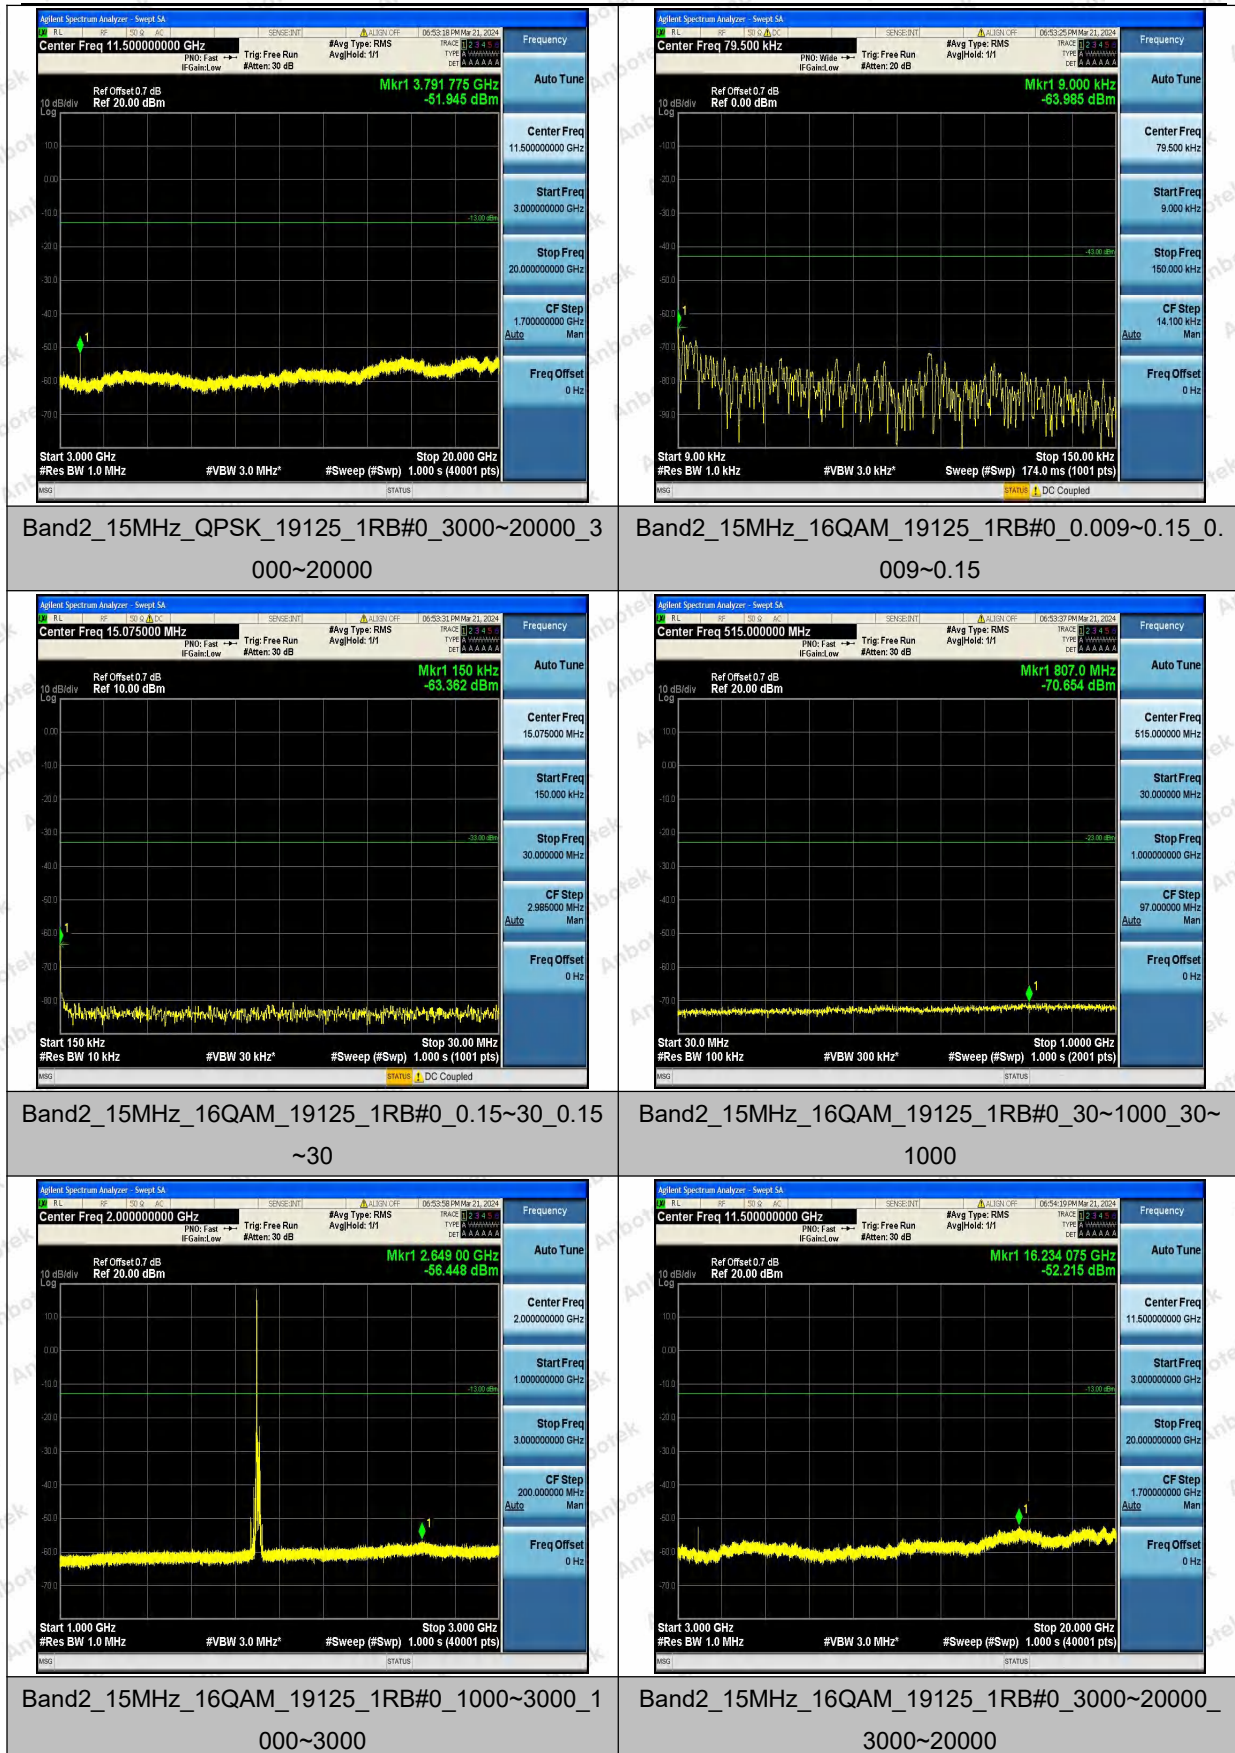


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



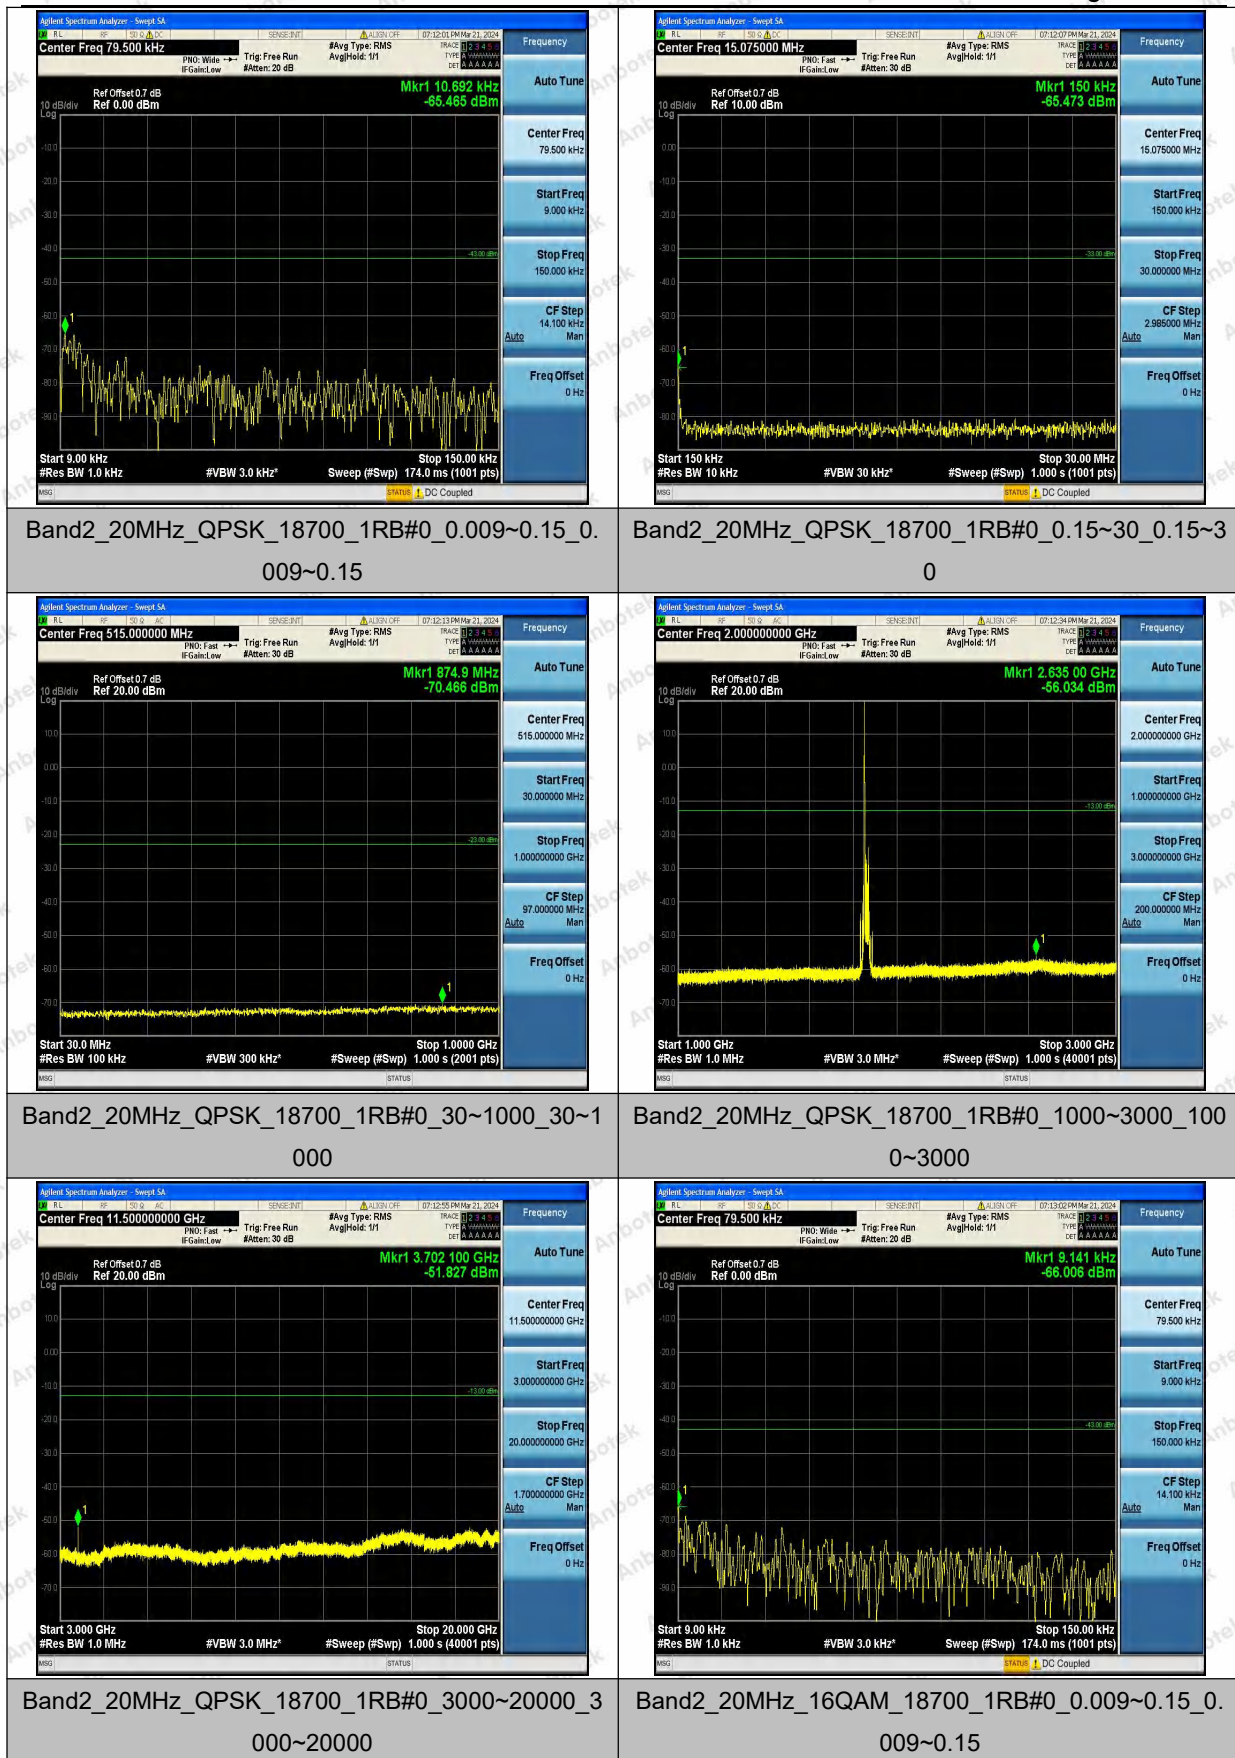


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



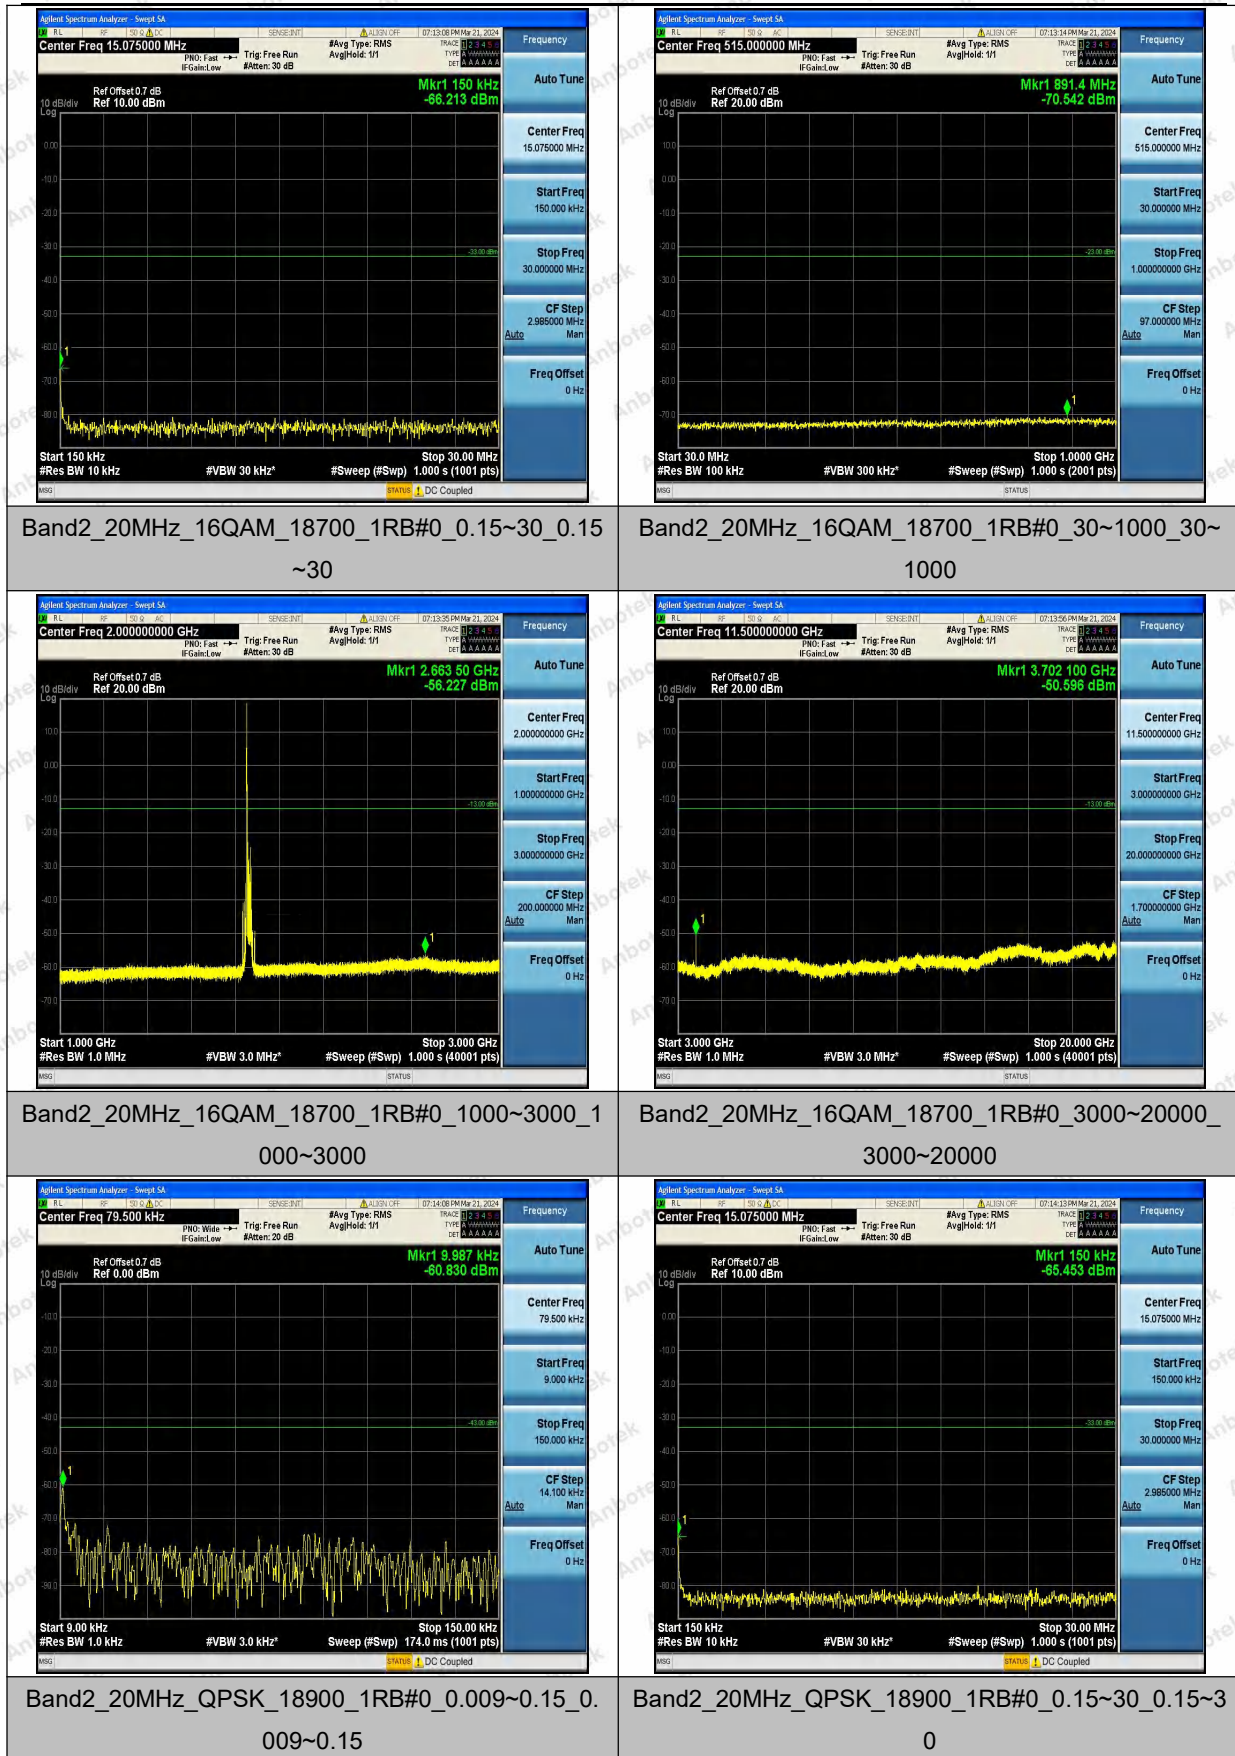


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



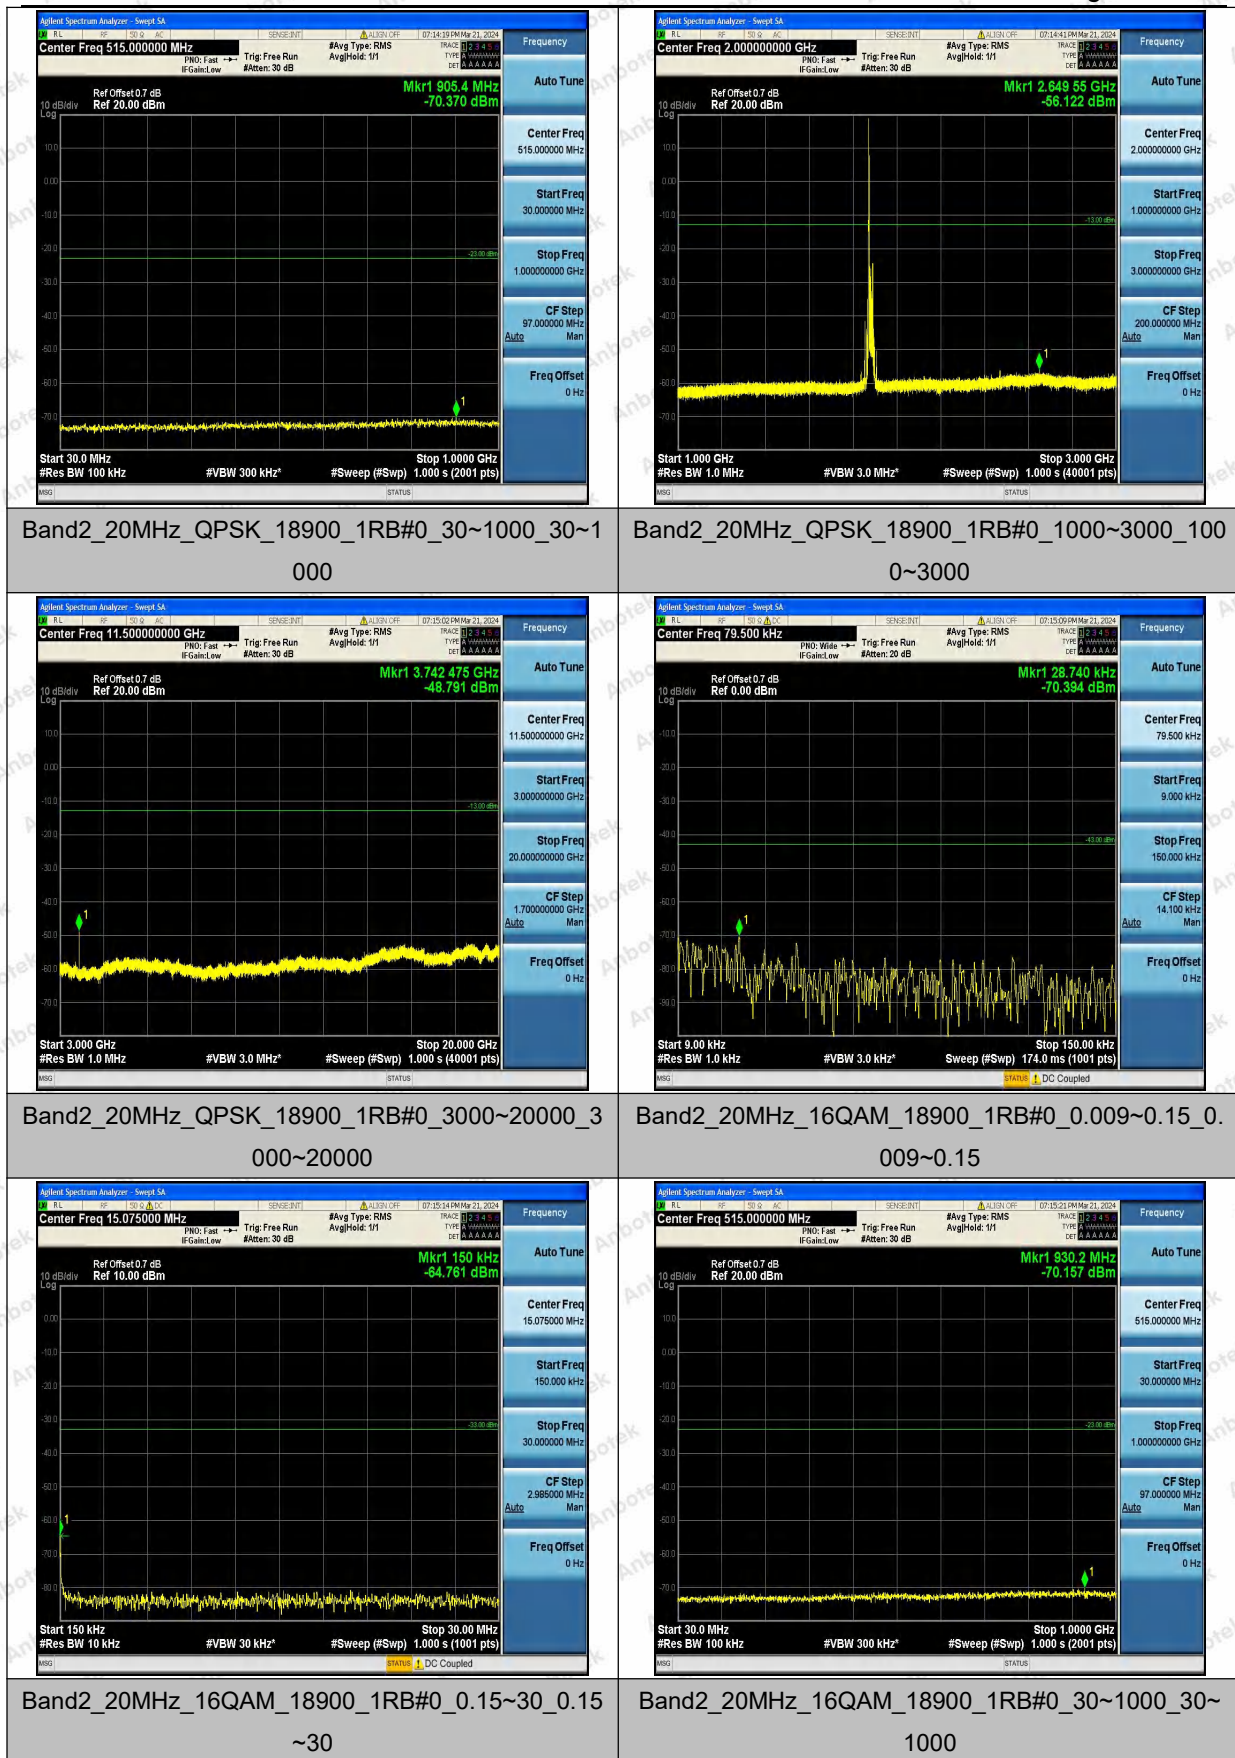


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



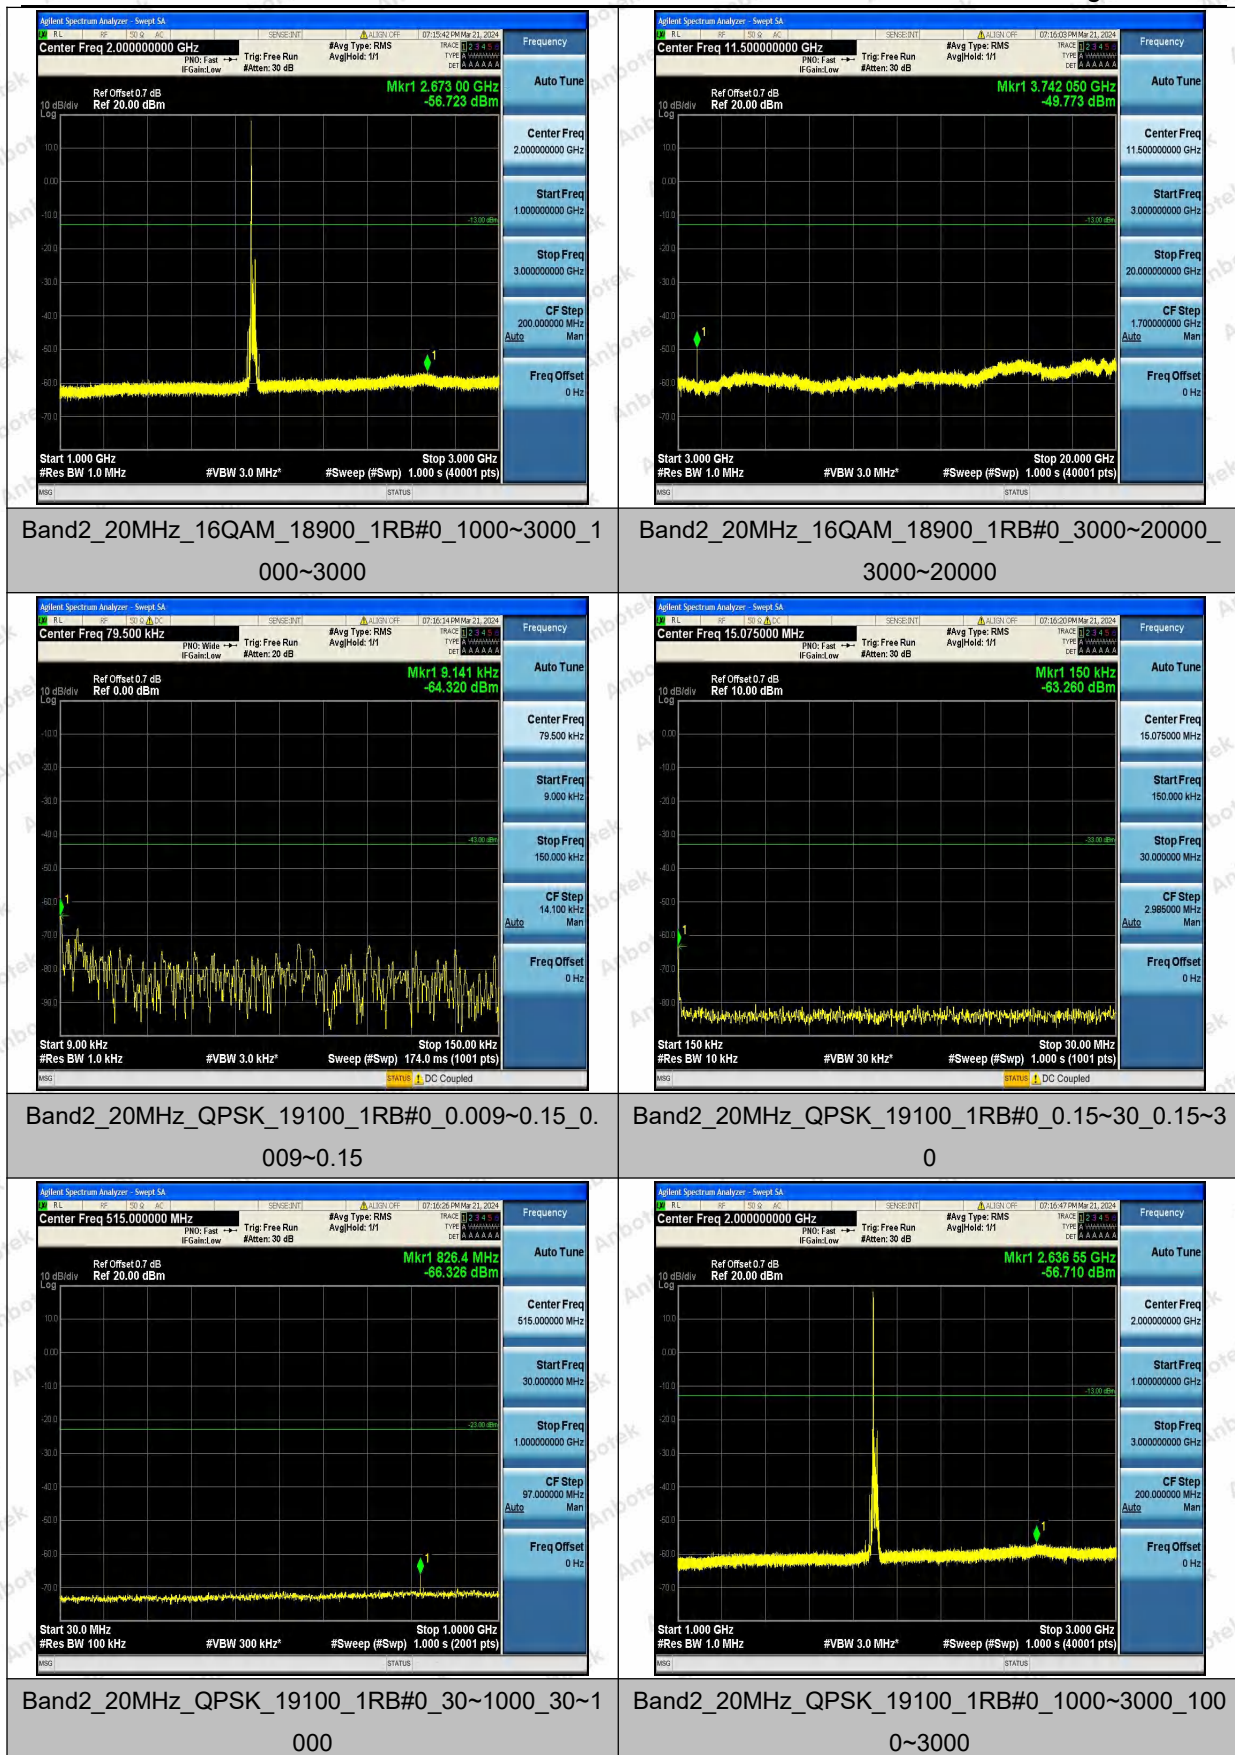


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



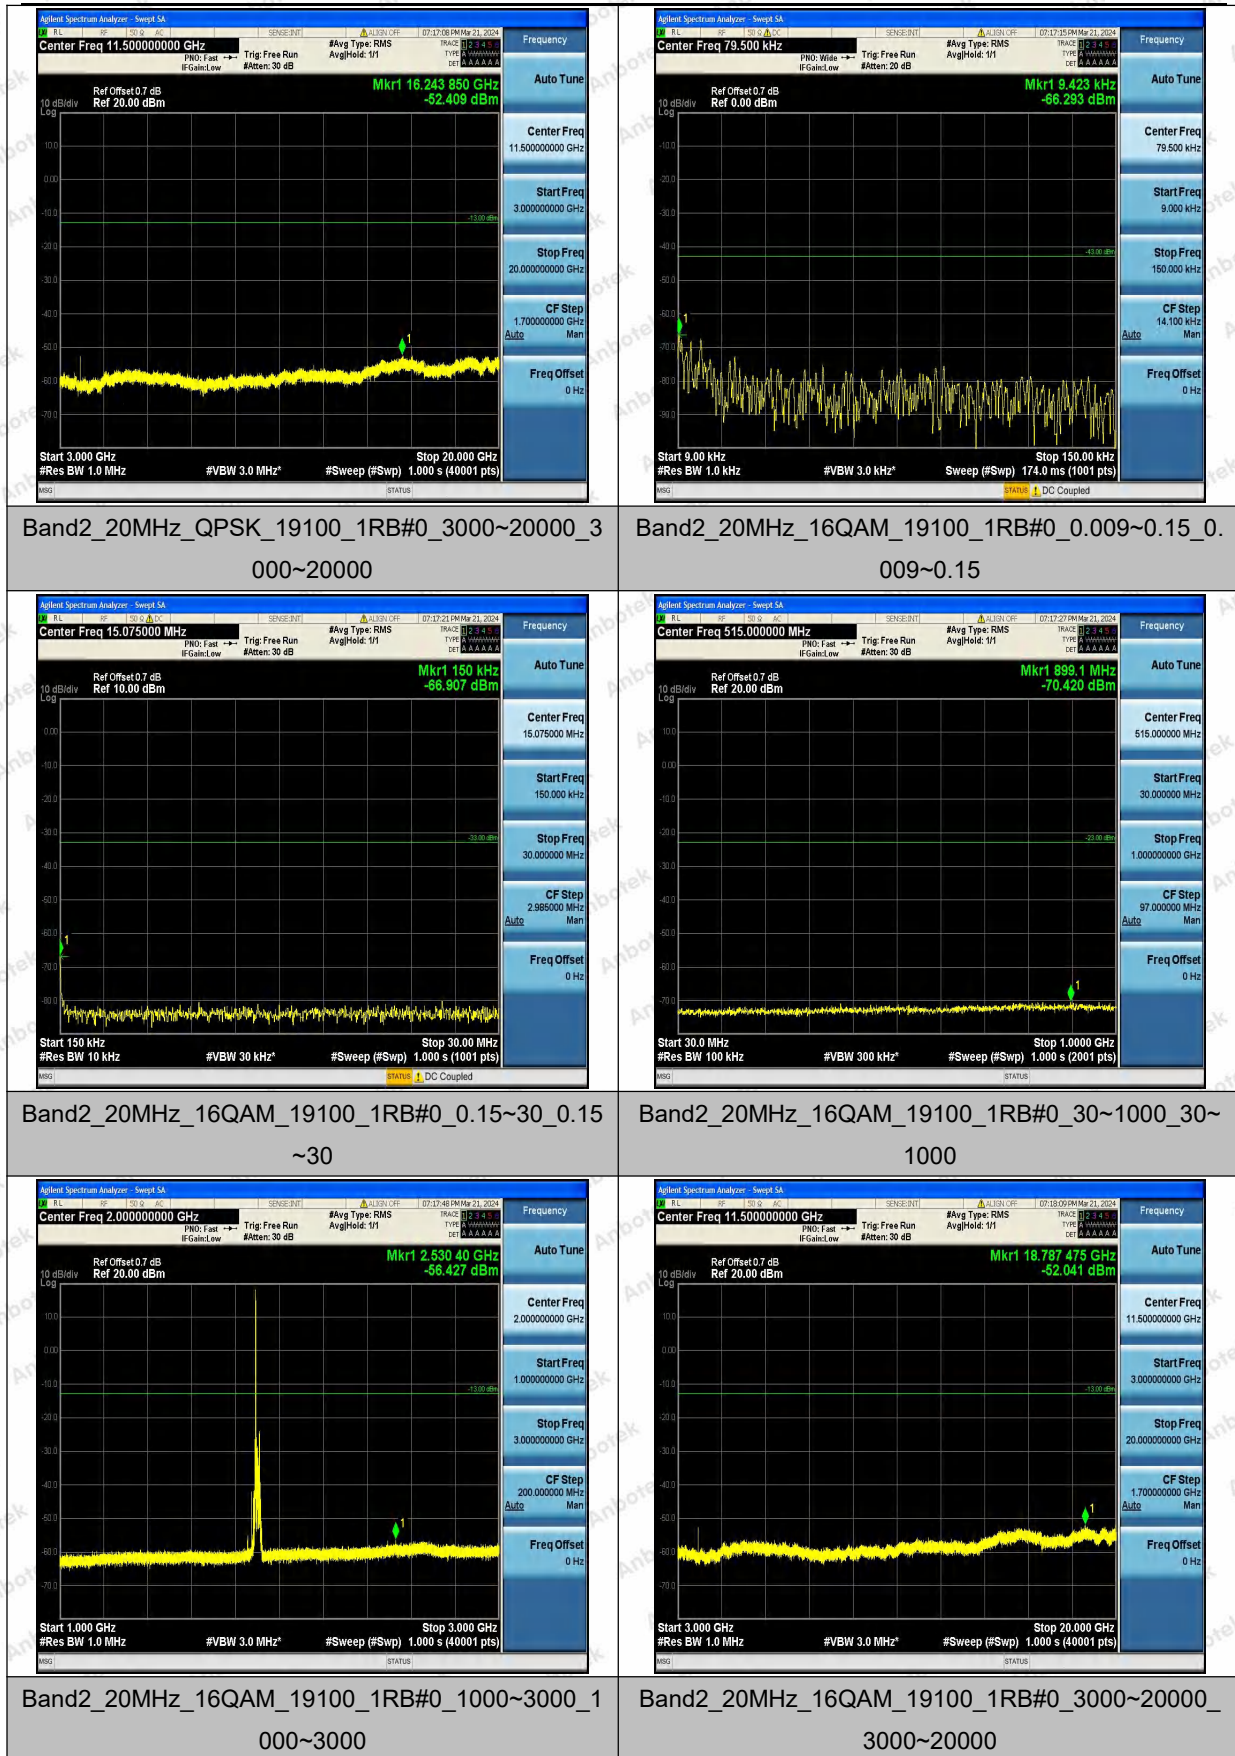

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix F: Frequency stability VS Voltage measurement

Test Result

Band	Bandwidth	Modulation	Channel	RB Configure	Voltage					
					Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	-11.80	-0.006376	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	-7.12	-0.003847	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	-8.70	-0.004701	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	-4.05	-0.002188	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	-6.62	-0.003577	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	4.19	0.002264	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	-13.36	-0.007106	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	-9.07	-0.004824	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	-7.51	-0.003995	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	-7.04	-0.003745	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	-6.25	-0.003324	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	-5.79	-0.003080	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	-11.54	-0.006044	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	-14.15	-0.007411	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	-14.26	-0.007469	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	-9.24	-0.004839	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	2.90	0.001519	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	-6.35	-0.003326	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VN	NT	-11.83	-0.006389	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	-11.34	-0.006125	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	-8.01	-0.004326	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	5.38	0.002906	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	9.06	0.004893	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	6.57	0.003548	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	-7.44	-0.003957	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	-7.34	-0.003904	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	-9.78	-0.005202	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	-8.71	-0.004633	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	-5.35	-0.002846	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	8.24	0.004383	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	-6.98	-0.003657	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	-7.47	-0.003914	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	-8.24	-0.004318	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VN	NT	-4.16	-0.002180	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VL	NT	7.02	0.003678	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band2	3MHz	16QAM	19185	15RB#0	VH	NT	-4.06	-0.002127	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	-12.93	-0.006980	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	-7.38	-0.003984	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	-8.83	-0.004767	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VN	NT	6.28	0.003390	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	6.04	0.003260	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	4.36	0.002354	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	-8.84	-0.004702	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	-9.04	-0.004809	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	6.52	0.003468	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	4.51	0.002399	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	9.57	0.005090	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	5.72	0.003043	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	-9.50	-0.004980	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	-10.96	-0.005746	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	-11.54	-0.006050	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	3.81	0.001997	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	7.08	0.003712	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	2.56	0.001342	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	-12.50	-0.006739	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	-11.97	-0.006453	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	-9.31	-0.005019	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VN	NT	11.54	0.006138	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	-7.98	-0.004245	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	-5.34	-0.002840	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	9.31	0.004887	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	-9.63	-0.005055	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	-8.67	-0.004551	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	-10.01	-0.005389	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	-7.04	-0.003790	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VH	NT	-7.05	-0.003795	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	13.52	0.007191	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VL	NT	-11.04	-0.005872	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	-4.95	-0.002633	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	8.10	0.004258	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	-7.31	-0.003842	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	-6.82	-0.003585	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VN	NT	-13.26	-0.007129	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VL	NT	-7.12	-0.003828	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VH	NT	-7.32	-0.003935	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	10.33	0.005495	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	20MHz	QPSK	18900	100RB#0	VL	NT	-6.29	-0.003346	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VH	NT	-4.95	-0.002633	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VN	NT	7.37	0.003879	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VL	NT	-8.48	-0.004463	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VH	NT	-9.41	-0.004953	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix G: Frequency stability VS Temperature measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-30	-7.27	-0.003928	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-20	-8.31	-0.004490	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-10	-6.98	-0.003772	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	0	-6.38	-0.003447	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	10	-7.00	-0.003782	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	20	-5.58	-0.003015	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	30	-4.63	-0.002502	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	40	-6.04	-0.003264	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	50	-8.05	-0.004350	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-30	-5.97	-0.003226	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-20	6.27	0.003388	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-10	-7.51	-0.004058	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	0	-4.69	-0.002534	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	10	-7.31	-0.003950	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	20	-5.41	-0.002923	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	30	-2.75	-0.001486	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	40	3.35	0.001810	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	50	-5.58	-0.003015	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	-7.24	-0.003851	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	-6.68	-0.003553	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-10	-8.04	-0.004277	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	-7.52	-0.004000	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	-7.17	-0.003814	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	-11.94	-0.006351	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	30	-6.61	-0.003516	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	40	-9.63	-0.005122	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	50	-7.57	-0.004027	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-30	3.95	0.002101	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-20	-6.52	-0.003468	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-10	-11.09	-0.005899	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	0	-3.49	-0.001856	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	10	-6.75	-0.003590	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	20	-4.69	-0.002495	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	30	-7.00	-0.003723	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	40	4.91	0.002612	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band2	1.4MHz	16QAM	18900	6RB#0	NV	50	7.18	0.003819	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-30	-14.00	-0.007333	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-20	-13.23	-0.006929	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-10	-8.70	-0.004557	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	0	-7.70	-0.004033	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	10	-9.60	-0.005028	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	20	-12.87	-0.006741	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	30	-10.54	-0.005520	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	40	6.04	0.003163	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	50	-8.63	-0.004520	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-30	-7.62	-0.003991	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-20	-4.88	-0.002556	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-10	6.28	0.003289	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	0	2.72	0.001425	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	10	7.55	0.003954	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	20	-4.38	-0.002294	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	30	-4.99	-0.002614	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	40	-5.25	-0.002750	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	50	5.84	0.003059	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-30	-8.00	-0.004321	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-20	-7.15	-0.003862	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-10	-9.21	-0.004974	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	0	-7.22	-0.003900	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	10	-4.21	-0.002274	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	20	-4.52	-0.002441	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	30	3.26	0.001761	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	40	7.25	0.003916	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	50	4.68	0.002528	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-30	9.58	0.005174	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-20	-6.61	-0.003570	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-10	7.18	0.003878	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	0	-3.43	-0.001853	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	10	7.72	0.004170	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	20	7.47	0.004035	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	30	6.59	0.003559	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	40	-6.49	-0.003505	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	50	9.16	0.004947	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-30	-8.93	-0.004750	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-20	-4.52	-0.002404	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-10	-8.00	-0.004255	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	-10.83	-0.005761	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	3MHz	QPSK	18900	15RB#0	NV	10	7.00	0.003723	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	6.90	0.003670	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	30	-5.55	-0.002952	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	40	4.94	0.002628	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	50	5.59	0.002973	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-30	6.08	0.003234	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-20	7.05	0.003750	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-10	-4.42	-0.002351	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	0	-6.39	-0.003399	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	10	6.08	0.003234	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	20	-6.18	-0.003287	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	30	-10.99	-0.005846	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	40	-6.28	-0.003340	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	50	5.14	0.002734	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-30	-7.60	-0.003982	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-20	-8.47	-0.004438	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-10	-4.06	-0.002127	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	0	-8.03	-0.004207	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	10	-8.47	-0.004438	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	20	-7.07	-0.003704	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	30	-9.11	-0.004773	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	40	4.82	0.002526	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	50	-5.21	-0.002730	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-30	-9.56	-0.005009	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-20	6.15	0.003222	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-10	6.11	0.003201	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	0	-3.69	-0.001933	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	10	-4.95	-0.002594	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	20	-9.46	-0.004957	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	30	3.76	0.001970	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	40	-6.85	-0.003589	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	50	-5.45	-0.002856	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-30	-4.38	-0.002364	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-20	-11.13	-0.006008	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-10	-4.78	-0.002580	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	0	-5.81	-0.003136	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	10	-7.22	-0.003897	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	20	-9.11	-0.004918	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	30	-6.47	-0.003493	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	40	5.21	0.002812	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	50	5.89	0.003179	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	5MHz	16QAM	18625	25RB#0	NV	-30	3.91	0.002111	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-20	-9.16	-0.004945	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-10	-5.11	-0.002758	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	0	6.65	0.003590	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	10	6.59	0.003557	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	20	4.56	0.002462	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	30	-4.71	-0.002543	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	40	-6.65	-0.003590	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	50	-7.18	-0.003876	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	-9.18	-0.004883	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	-6.08	-0.003234	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-10	-7.88	-0.004191	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	0	6.32	0.003362	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	-7.25	-0.003856	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	-8.20	-0.004362	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	30	-8.38	-0.004457	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	40	-4.31	-0.002293	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	50	2.73	0.001452	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-30	5.69	0.003027	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-20	5.85	0.003112	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-10	5.09	0.002707	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	0	9.24	0.004915	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	10	7.35	0.003910	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	20	4.55	0.002420	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	30	7.50	0.003989	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	40	-7.37	-0.003920	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	50	-5.62	-0.002989	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-30	-11.49	-0.006024	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-20	-12.00	-0.006291	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-10	-5.49	-0.002878	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	0	-6.61	-0.003465	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	10	-5.56	-0.002915	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	20	-8.08	-0.004236	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	30	6.45	0.003381	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	40	-5.99	-0.003140	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	50	-7.40	-0.003879	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-30	-3.09	-0.001620	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-20	5.99	0.003140	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-10	-6.42	-0.003366	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	0	-6.78	-0.003554	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	10	-5.16	-0.002705	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	5MHz	16QAM	19175	25RB#0	NV	20	6.54	0.003429	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	30	4.71	0.002469	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	40	-6.54	-0.003429	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	50	5.08	0.002663	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-30	-9.54	-0.005143	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-20	-5.66	-0.003051	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-10	-5.81	-0.003132	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	0	-8.58	-0.004625	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	10	-7.02	-0.003784	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	20	-7.32	-0.003946	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	30	4.85	0.002615	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	40	-5.48	-0.002954	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	50	-6.67	-0.003596	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	-3.65	-0.001941	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-20	-8.37	-0.004452	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-10	-5.99	-0.003186	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	5.46	0.002904	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	-5.68	-0.003021	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	4.91	0.002612	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	30	6.31	0.003356	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	40	-7.01	-0.003729	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	50	8.96	0.004766	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-30	-5.71	-0.002997	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-20	-9.00	-0.004724	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-10	-6.14	-0.003223	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	0	-5.38	-0.002824	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	10	-6.98	-0.003664	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	20	-3.88	-0.002037	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	30	-7.47	-0.003921	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	40	7.64	0.004010	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	50	-7.75	-0.004068	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-30	-9.80	-0.005276	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-20	-10.47	-0.005637	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-10	-7.95	-0.004280	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	0	-4.72	-0.002541	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	10	-5.69	-0.003063	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	20	-9.11	-0.004904	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	30	-8.00	-0.004307	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	40	5.31	0.002859	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	50	5.16	0.002778	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-30	-6.32	-0.003362	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	15MHz	QPSK	18900	75RB#0	NV	-20	-4.75	-0.002527	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-10	6.49	0.003452	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	0	4.78	0.002543	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	10	6.01	0.003197	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	20	-5.41	-0.002878	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	30	-5.11	-0.002718	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	40	-4.63	-0.002463	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	50	-4.85	-0.002580	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-30	-8.28	-0.004352	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-20	-5.76	-0.003028	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-10	-3.92	-0.002060	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	0	-4.06	-0.002134	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	10	-5.12	-0.002691	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	20	-7.15	-0.003758	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	30	-6.15	-0.003233	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	40	2.90	0.001524	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	50	7.14	0.003753	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-30	-6.82	-0.003667	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-20	-5.45	-0.002930	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-10	3.83	0.002059	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	0	5.74	0.003086	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	10	-5.74	-0.003086	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	20	6.77	0.003640	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	30	6.97	0.003747	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	40	-5.46	-0.002935	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	50	-7.32	-0.003935	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-30	-8.05	-0.004282	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-20	-8.18	-0.004351	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-10	8.13	0.004324	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	0	-7.67	-0.004080	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	10	5.24	0.002787	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	20	5.26	0.002798	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	30	6.34	0.003372	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	40	-5.74	-0.003053	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	50	5.21	0.002771	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-30	-8.54	-0.004495	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-20	-4.19	-0.002205	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-10	-6.22	-0.003274	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	0	-5.89	-0.003100	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	10	3.53	0.001858	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	20	-4.52	-0.002379	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	20MHz	QPSK	19100	100RB#0	NV	30	-7.68	-0.004042	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	40	5.09	0.002679	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	50	6.47	0.003405	±2.5	PASS

---END---

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn

