





Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

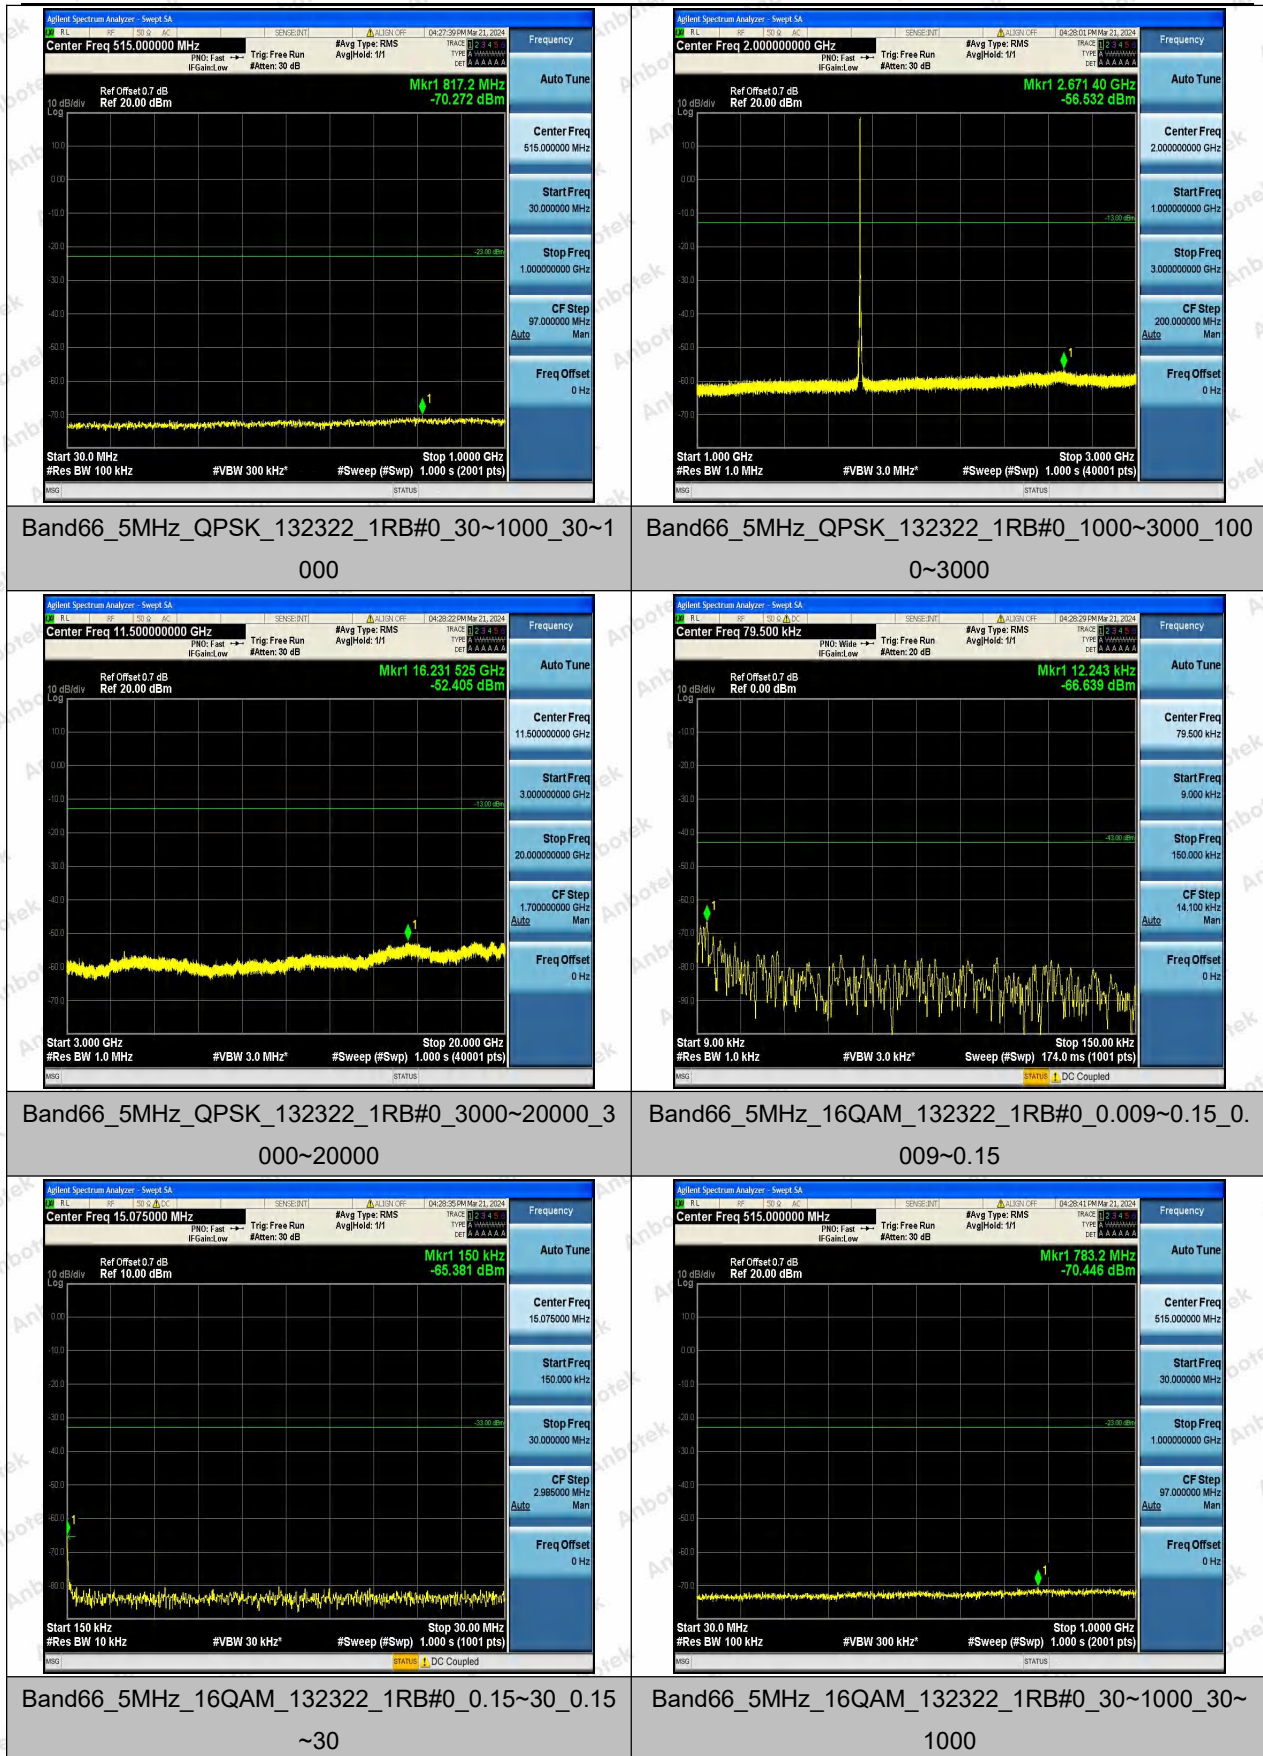

Hotline
 400-003-0500
 www.anbotek.com.cn



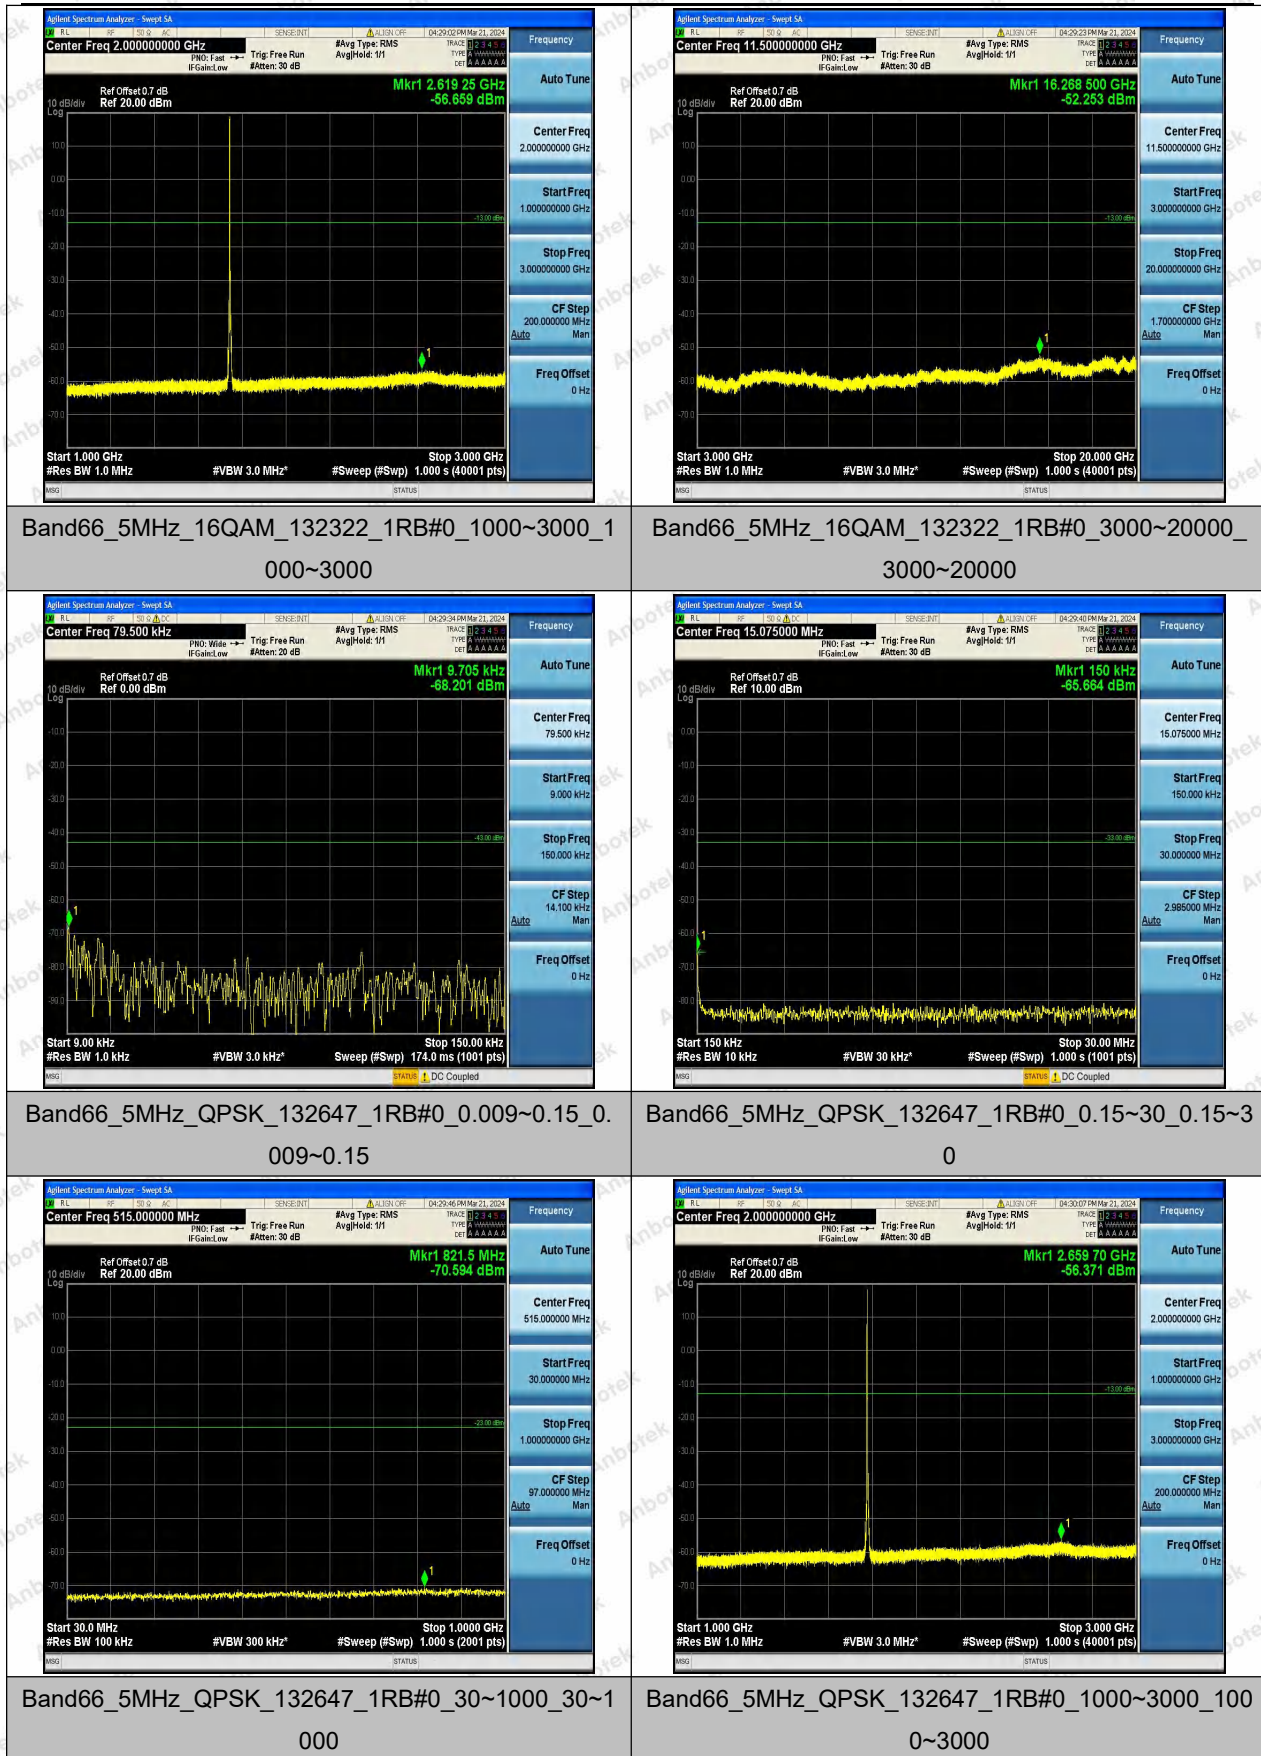

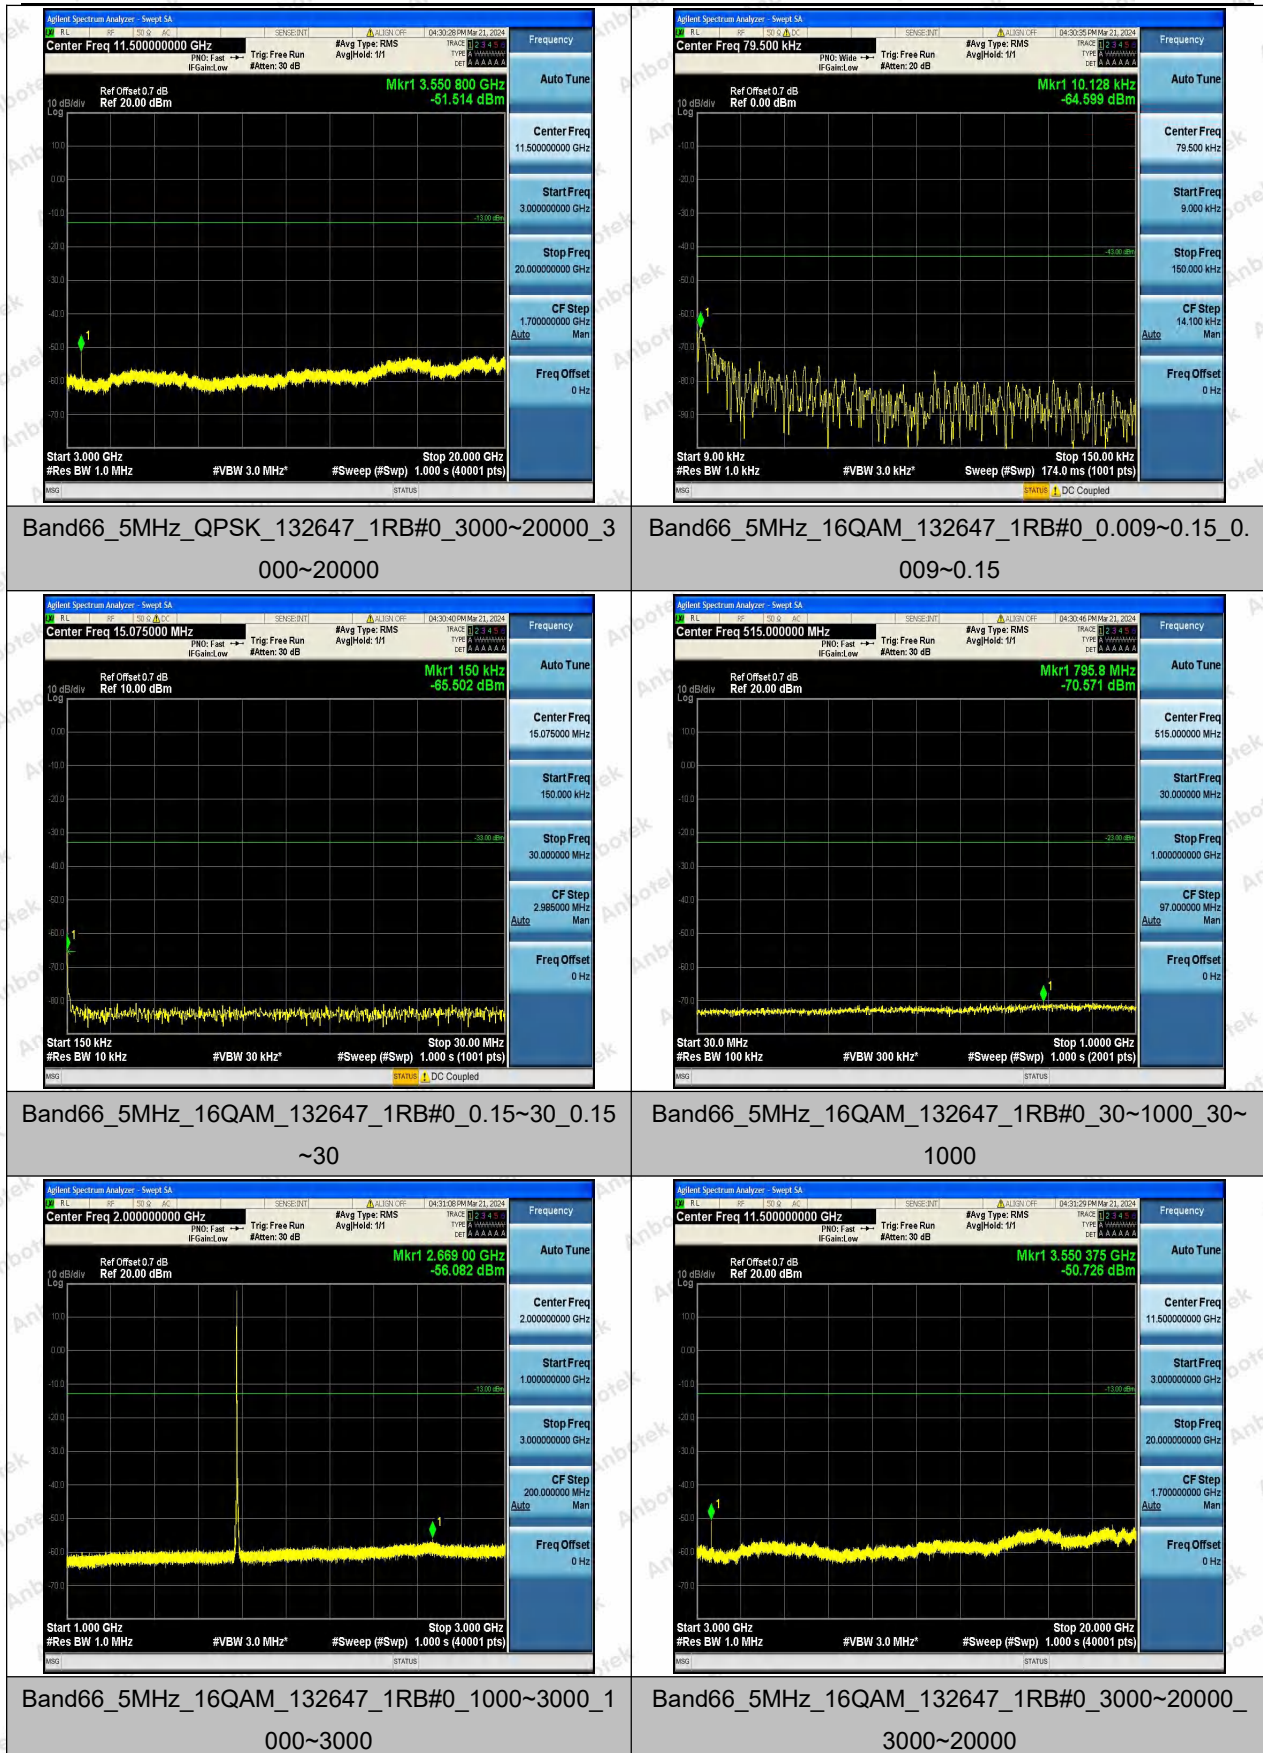


Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
 400-003-0500
 www.anbotek.com.cn



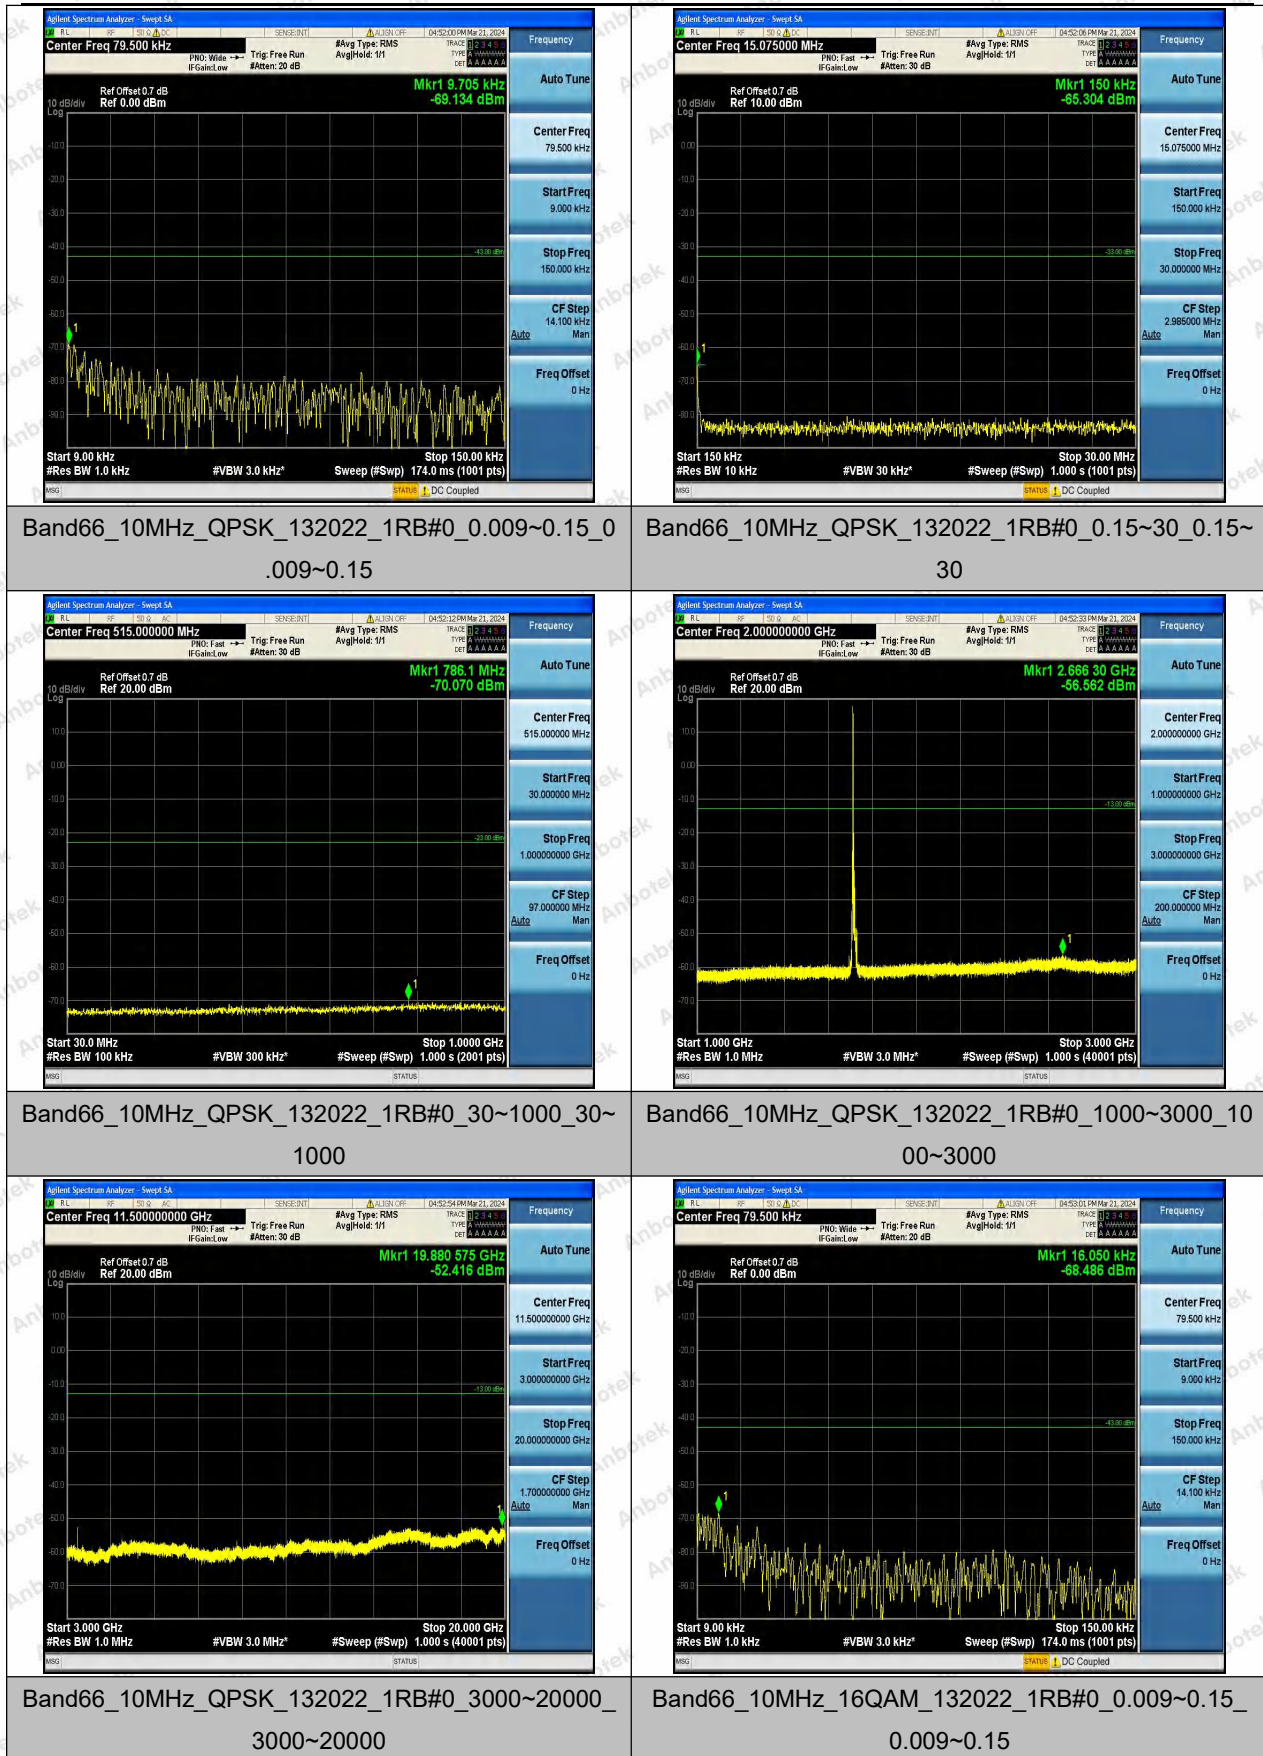

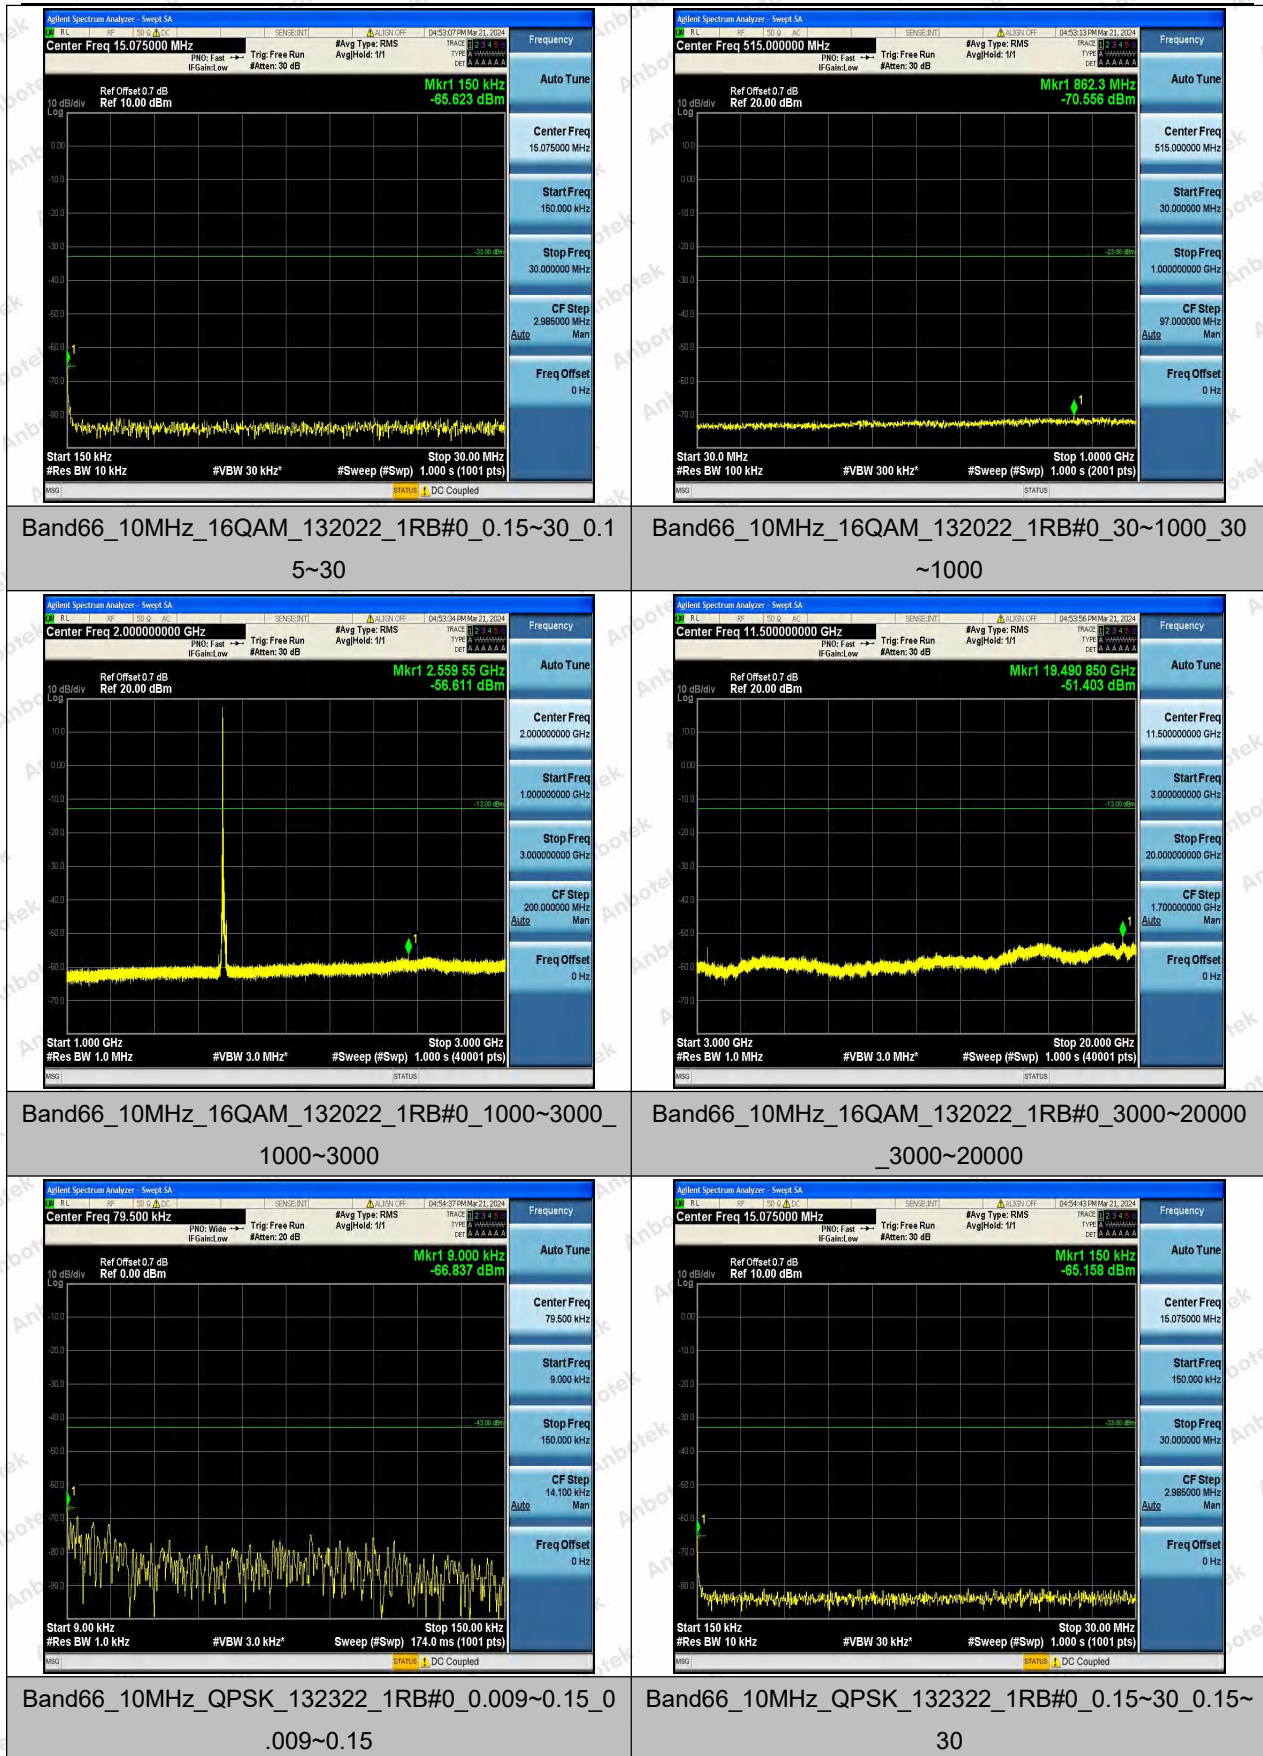

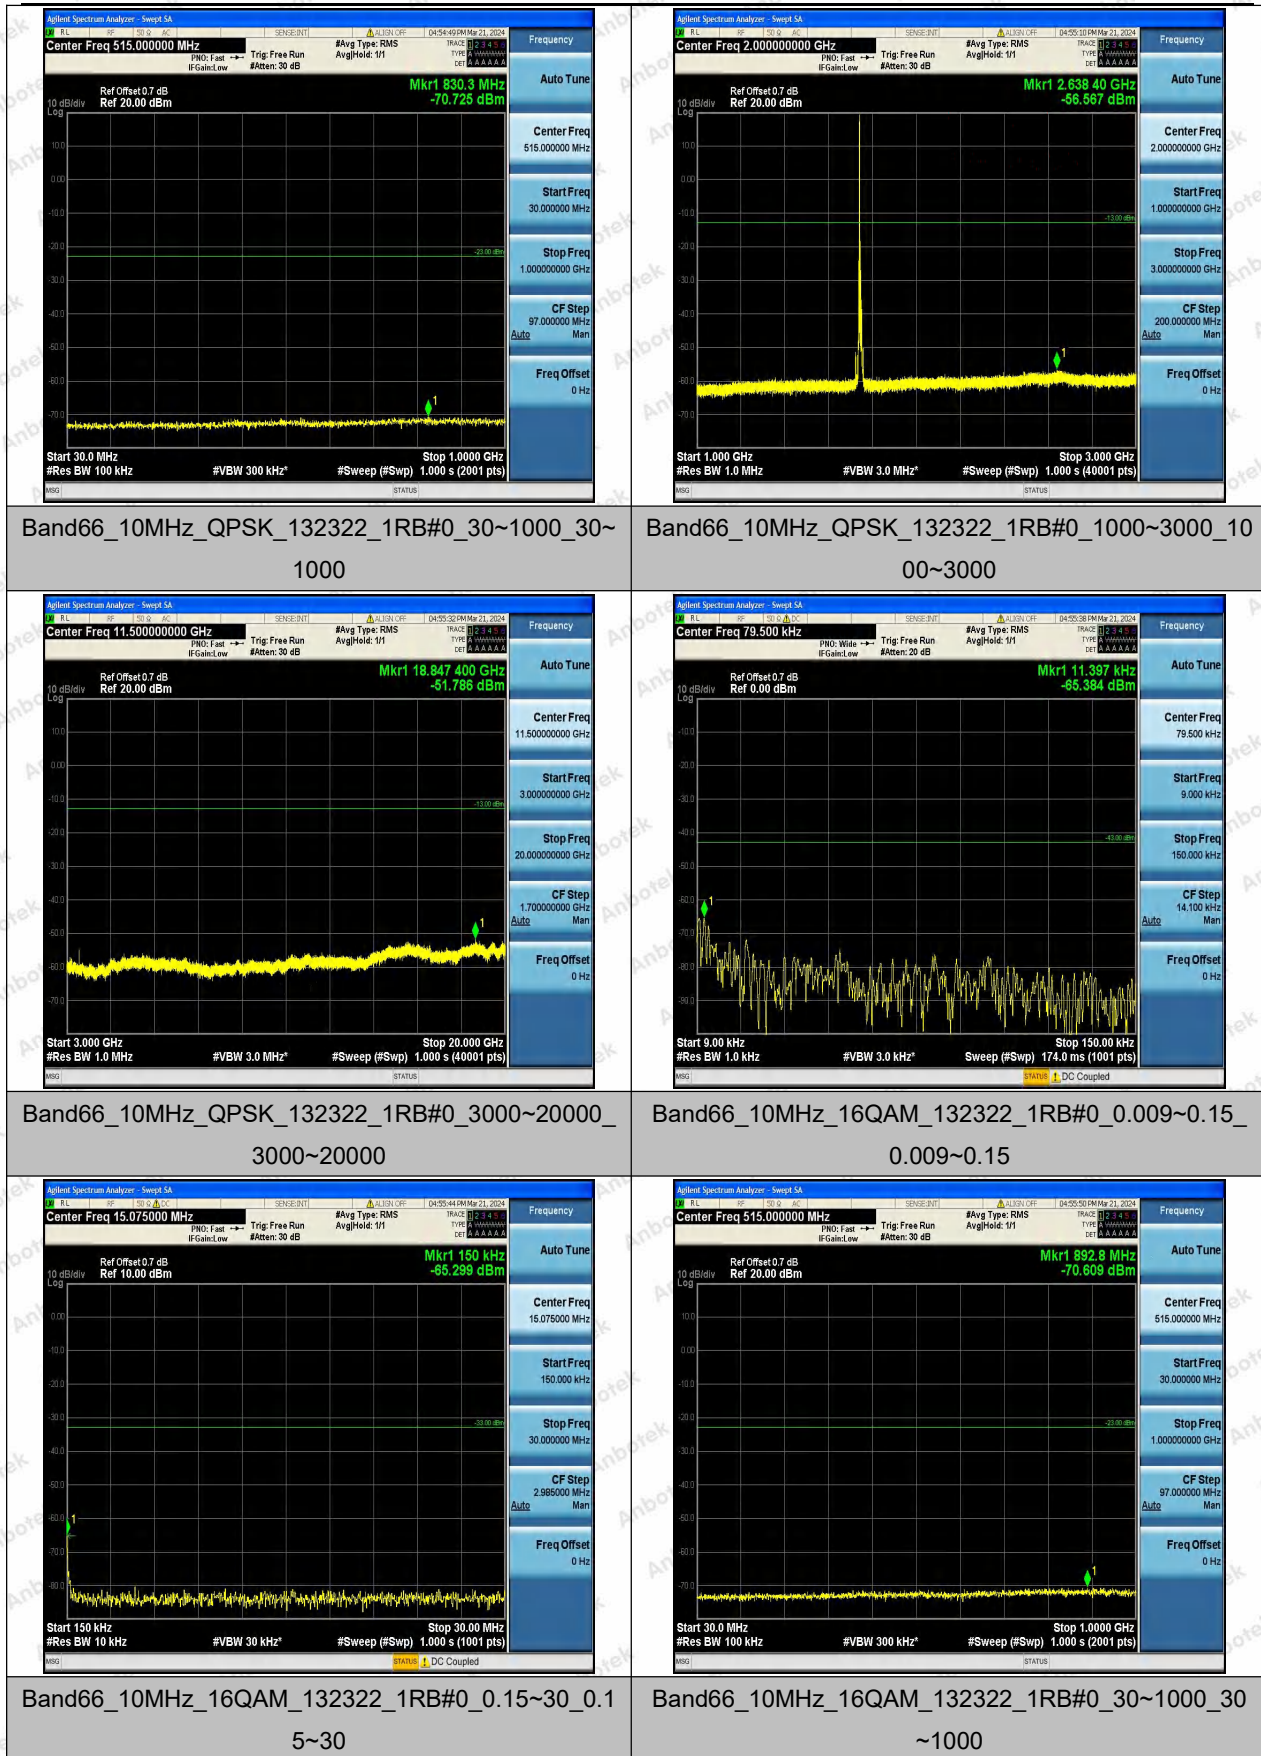


Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com





Hotline
400-003-0500
www.anbotek.com.cn




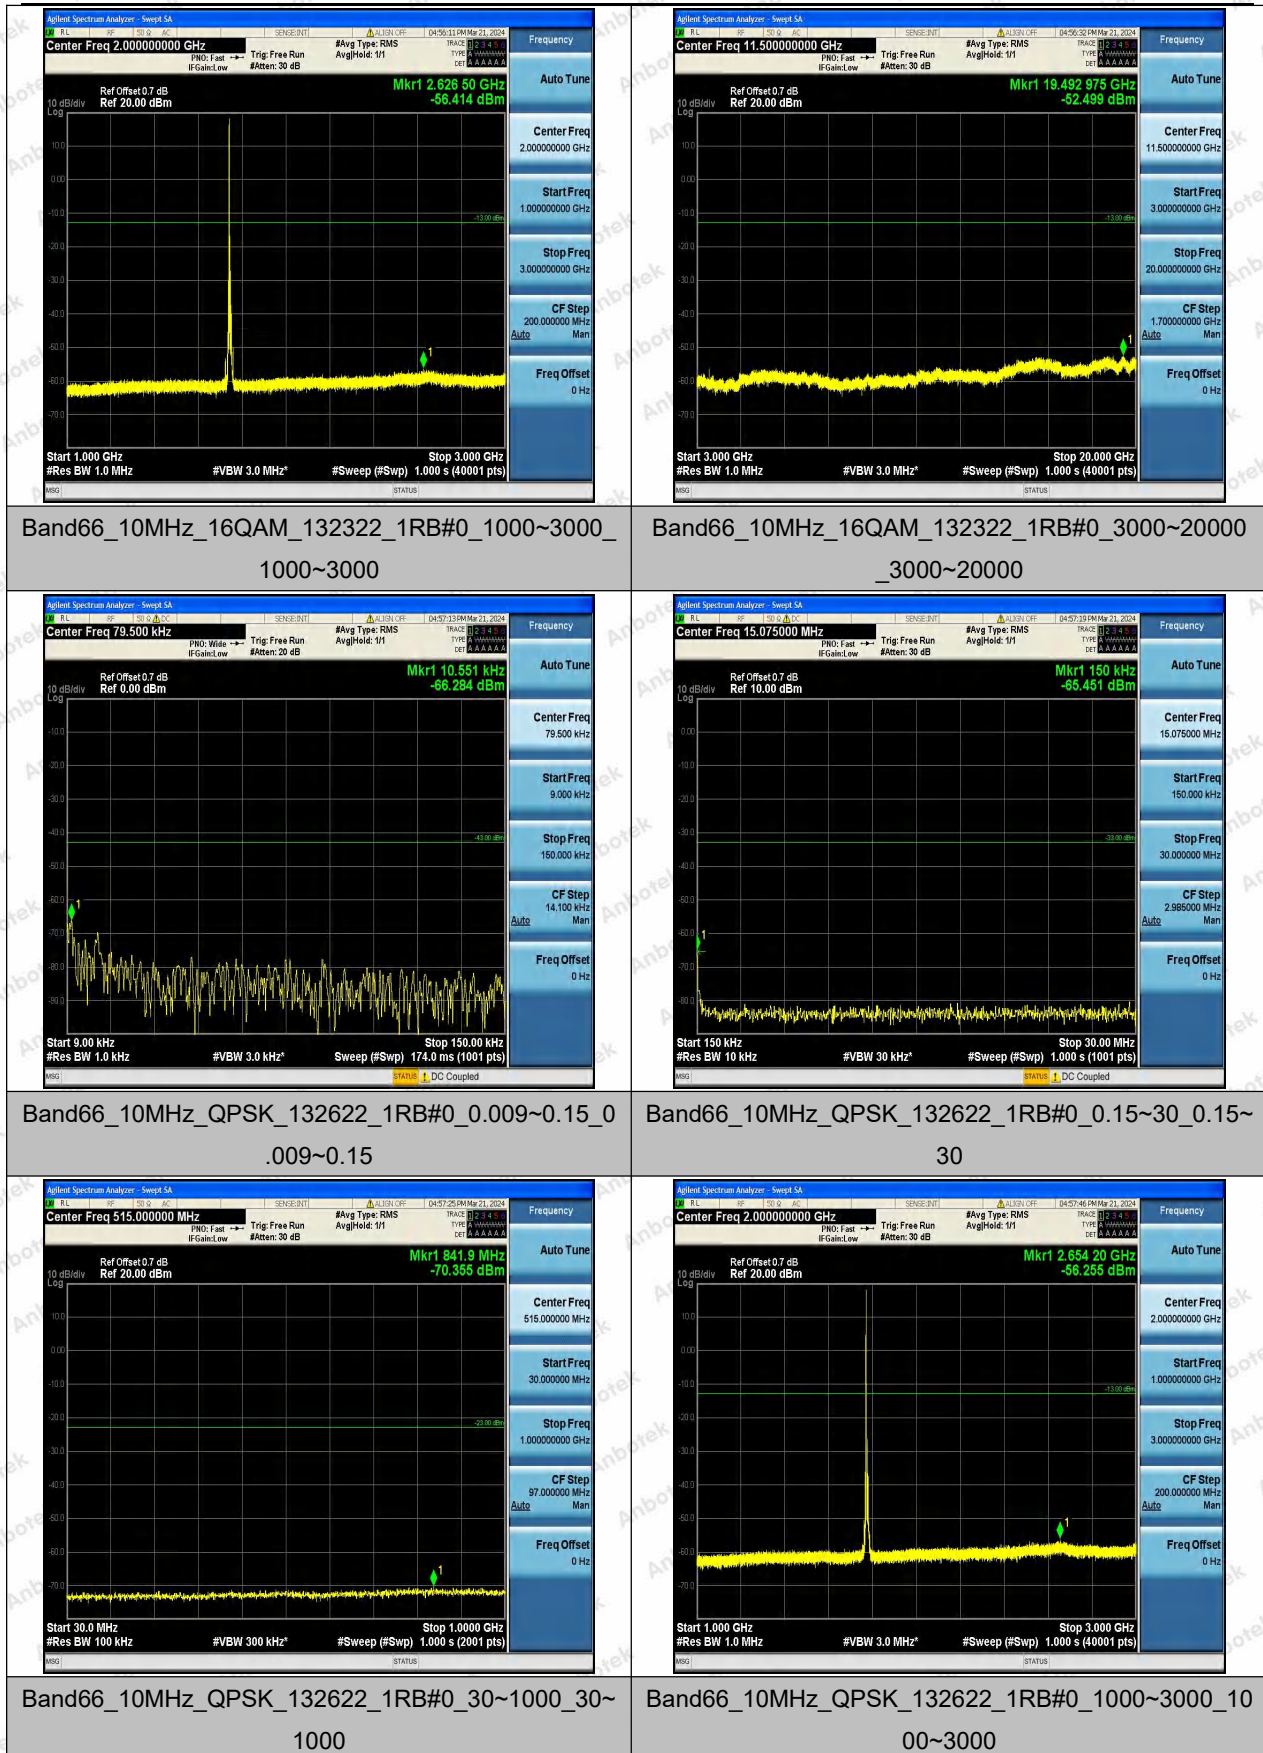


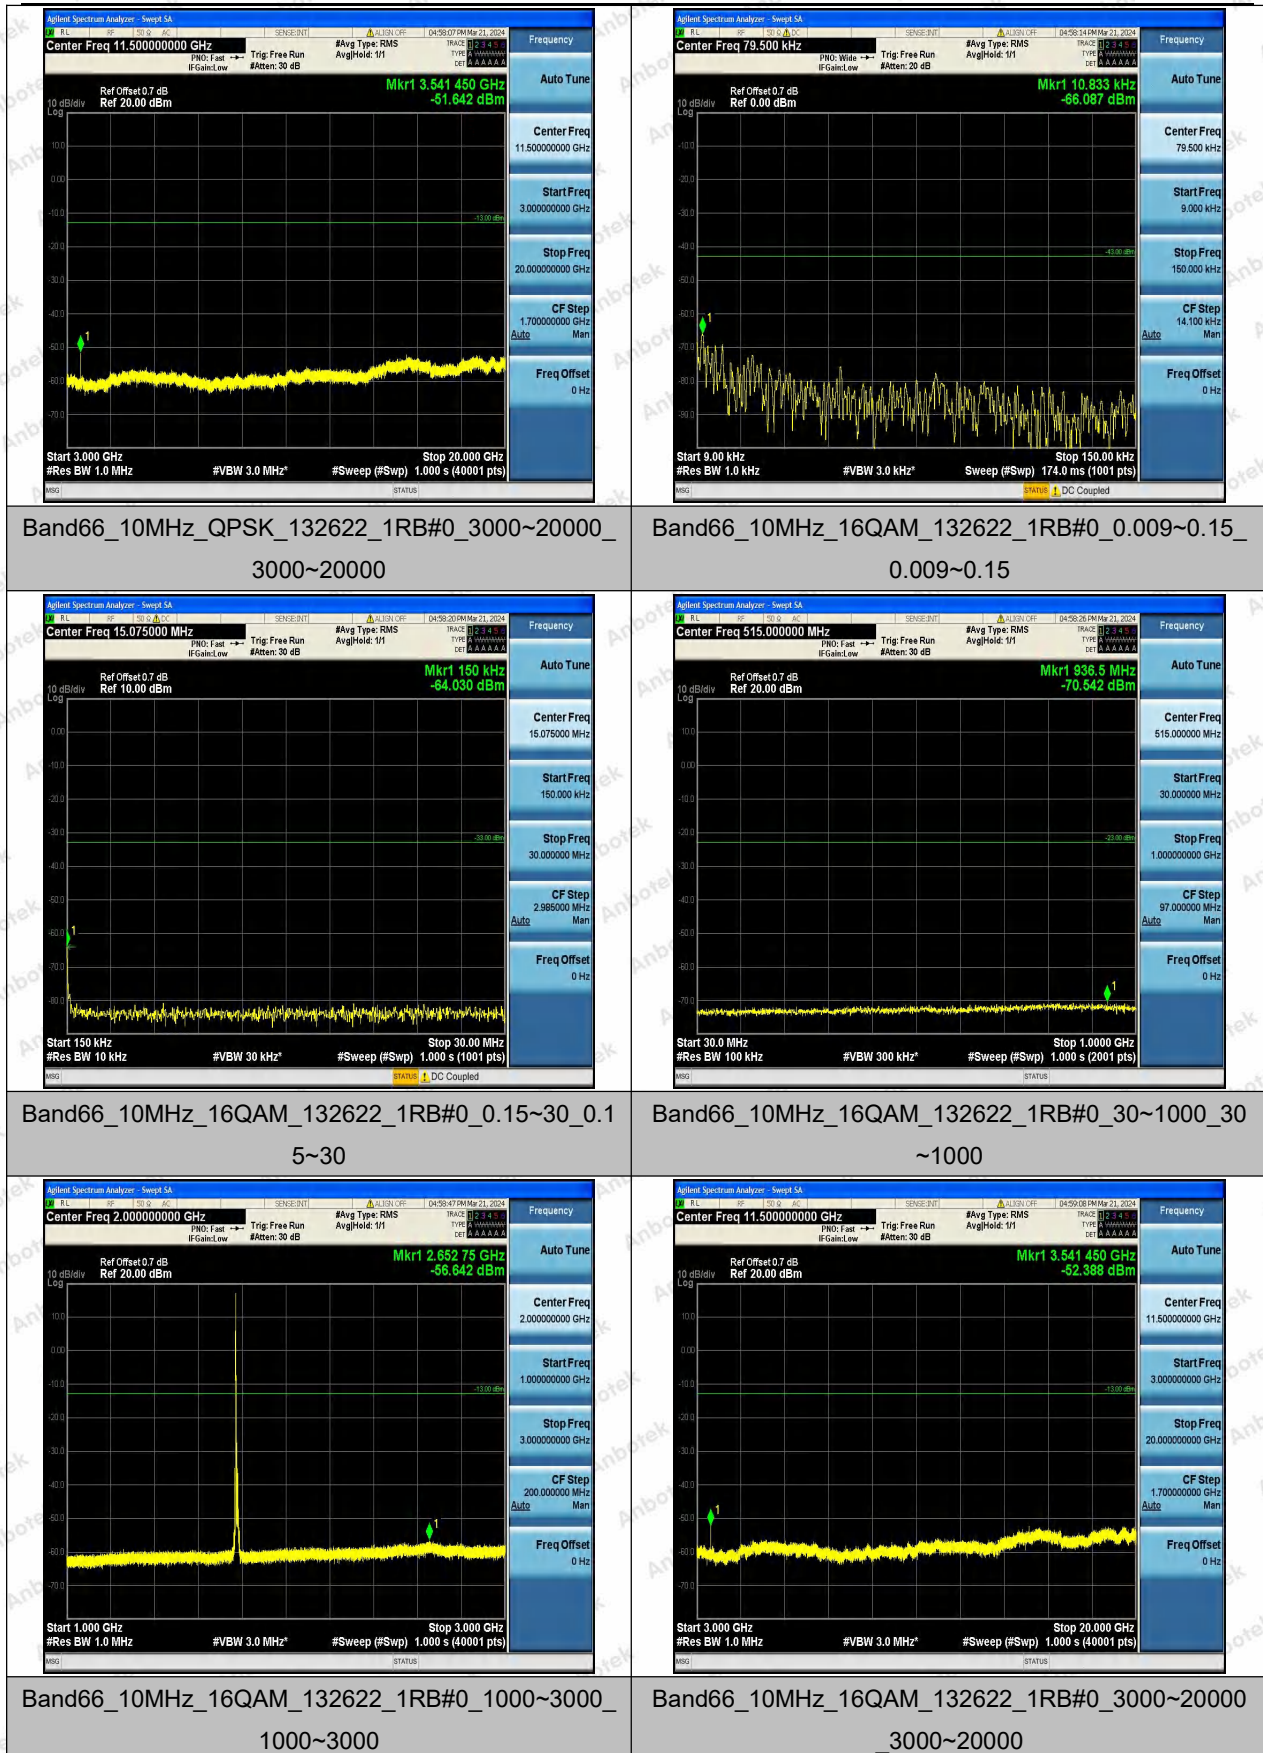


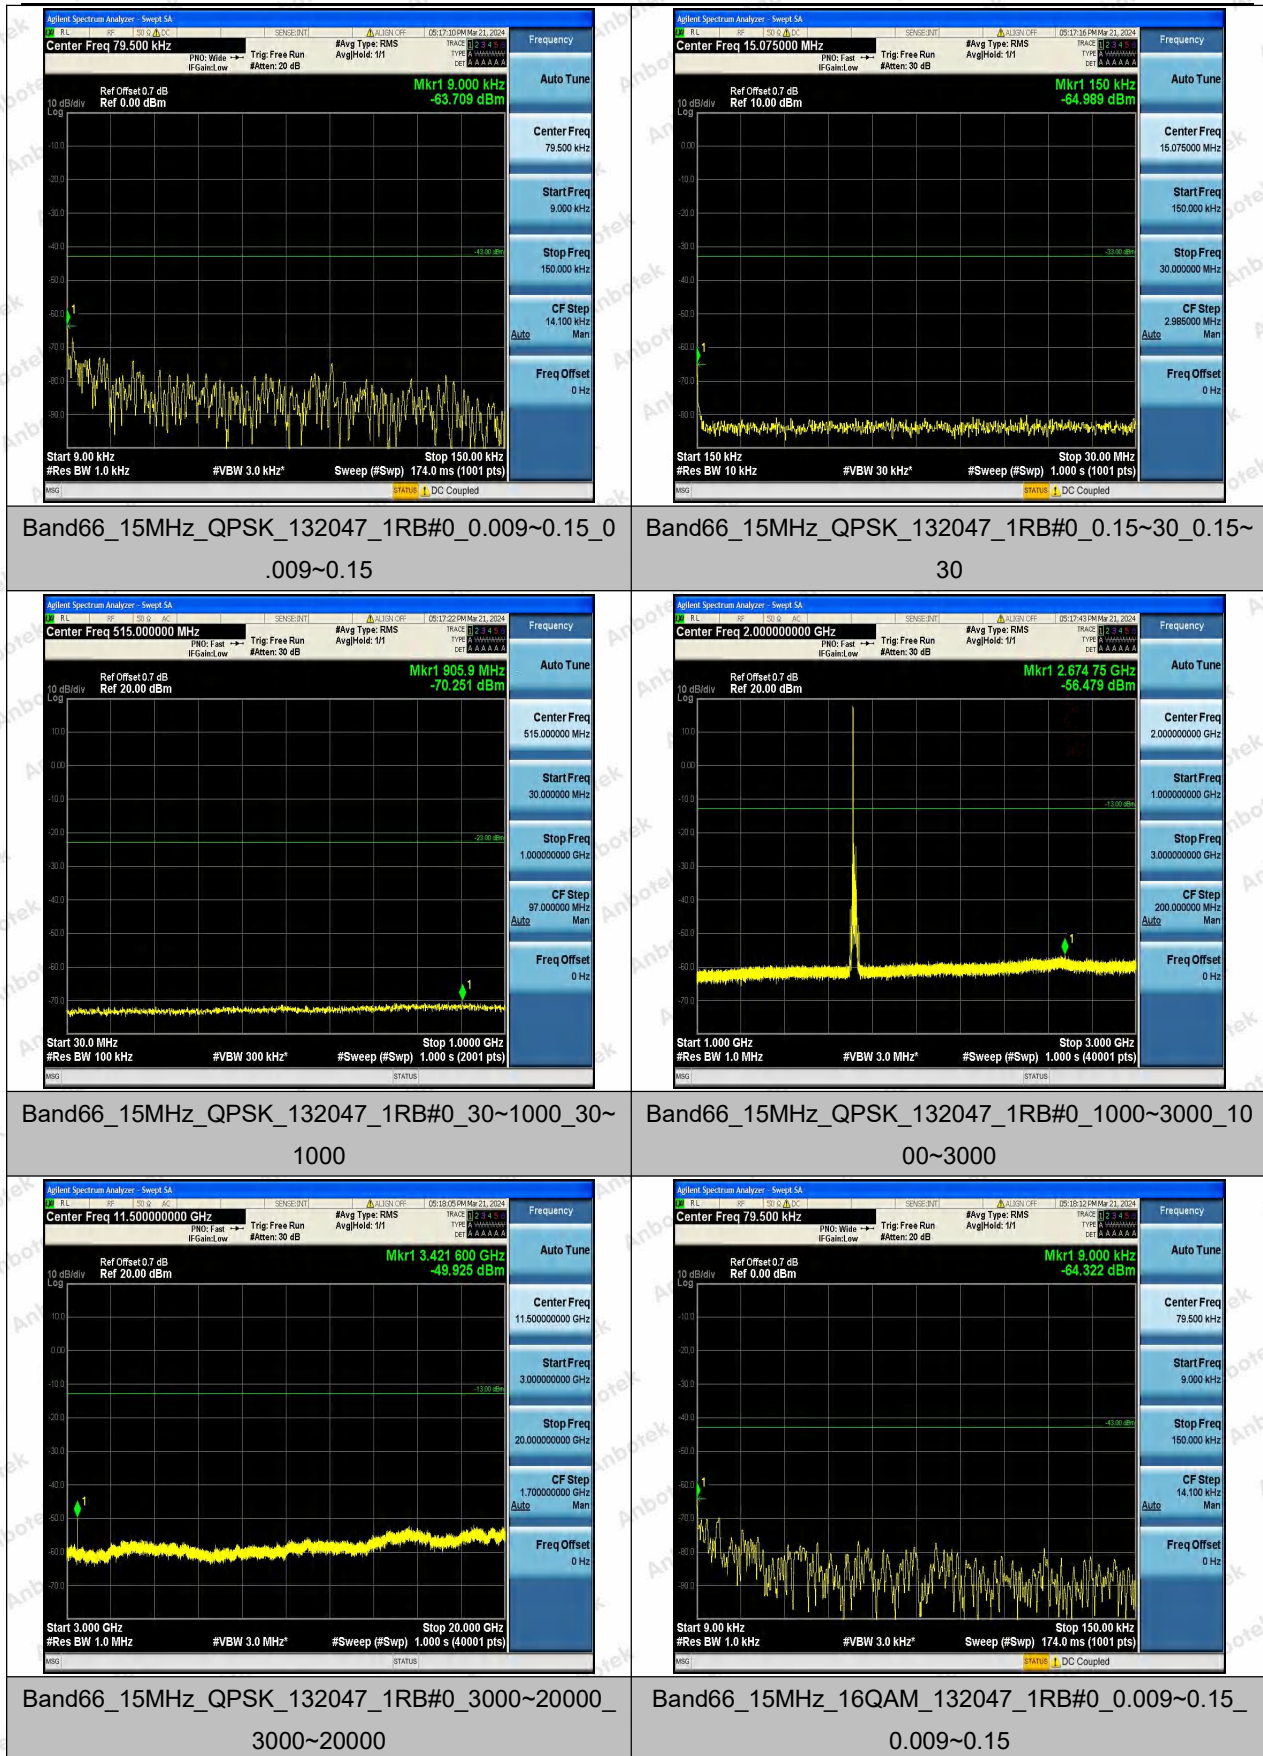


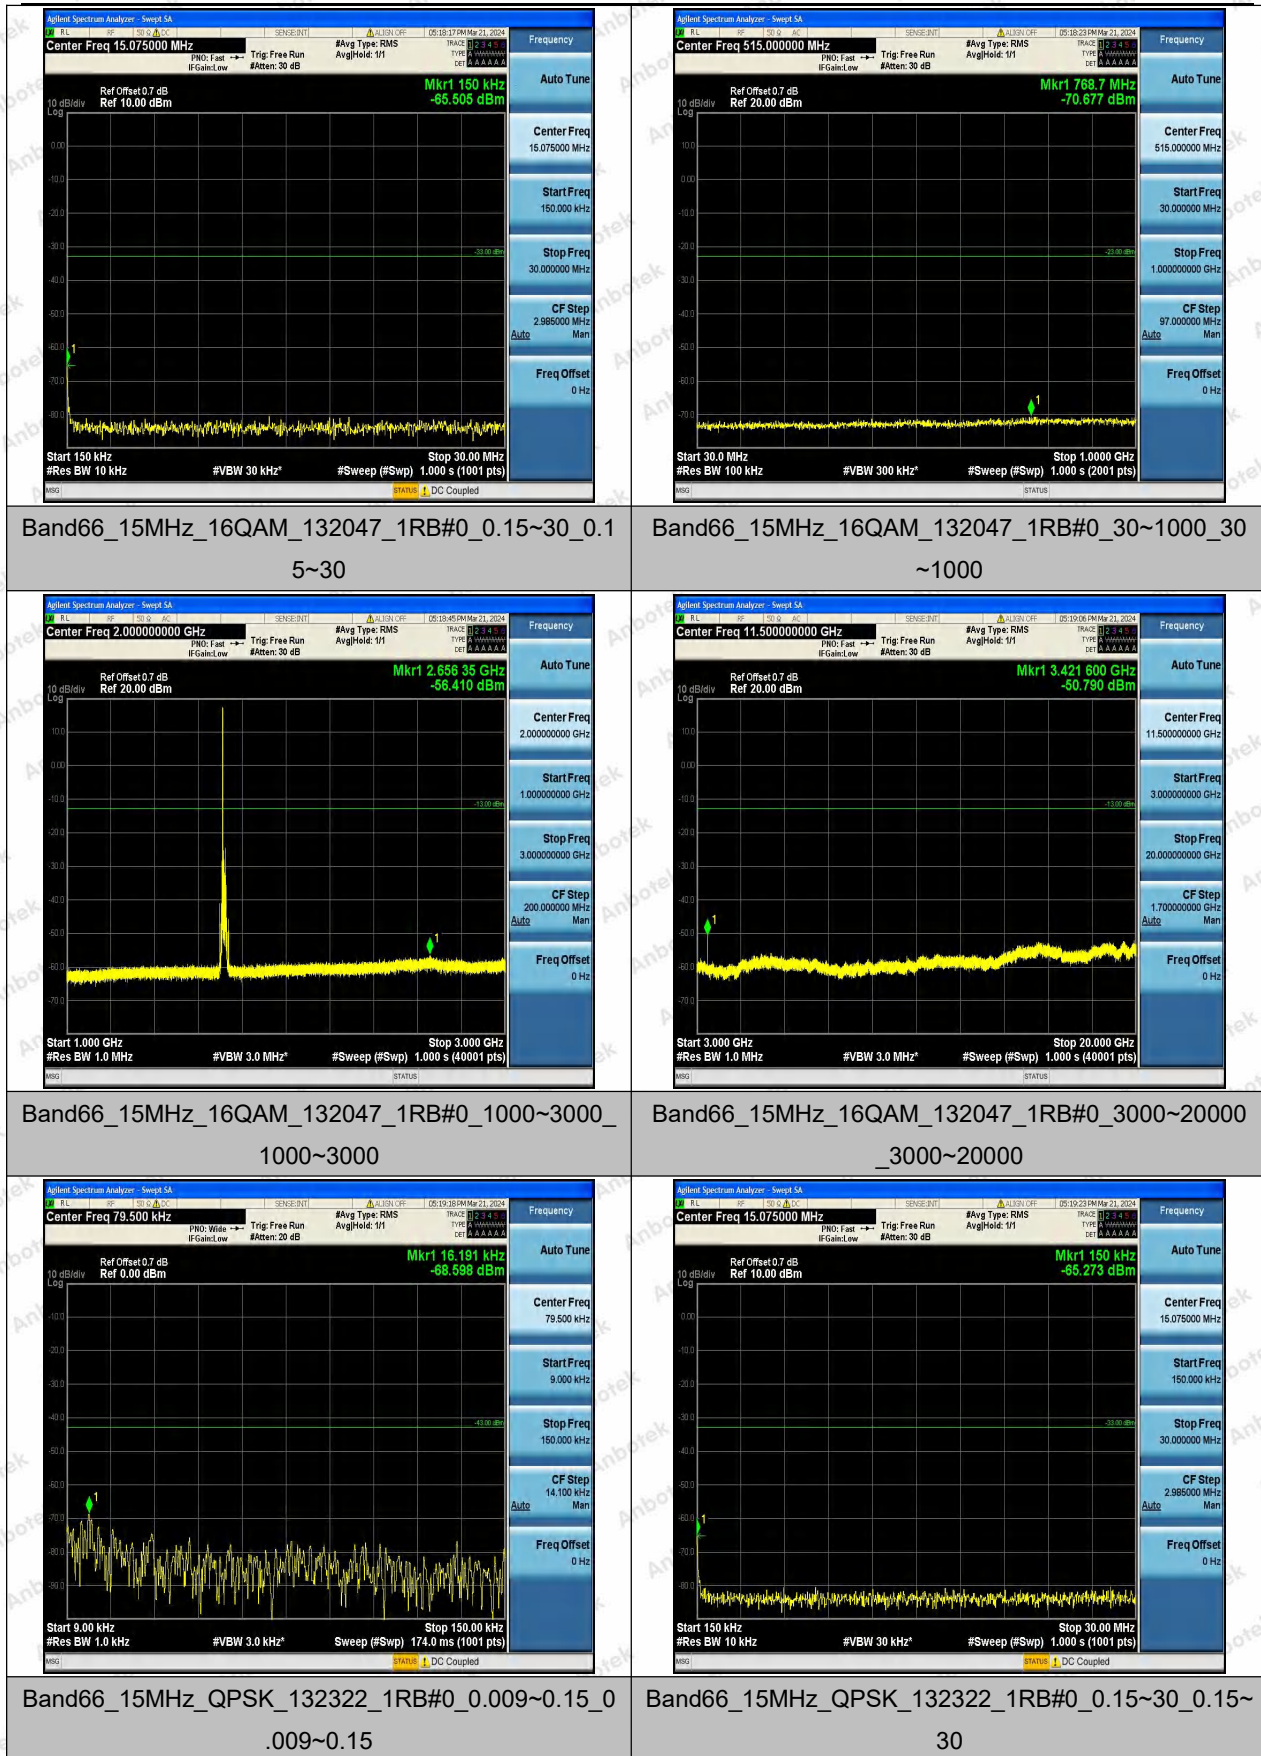

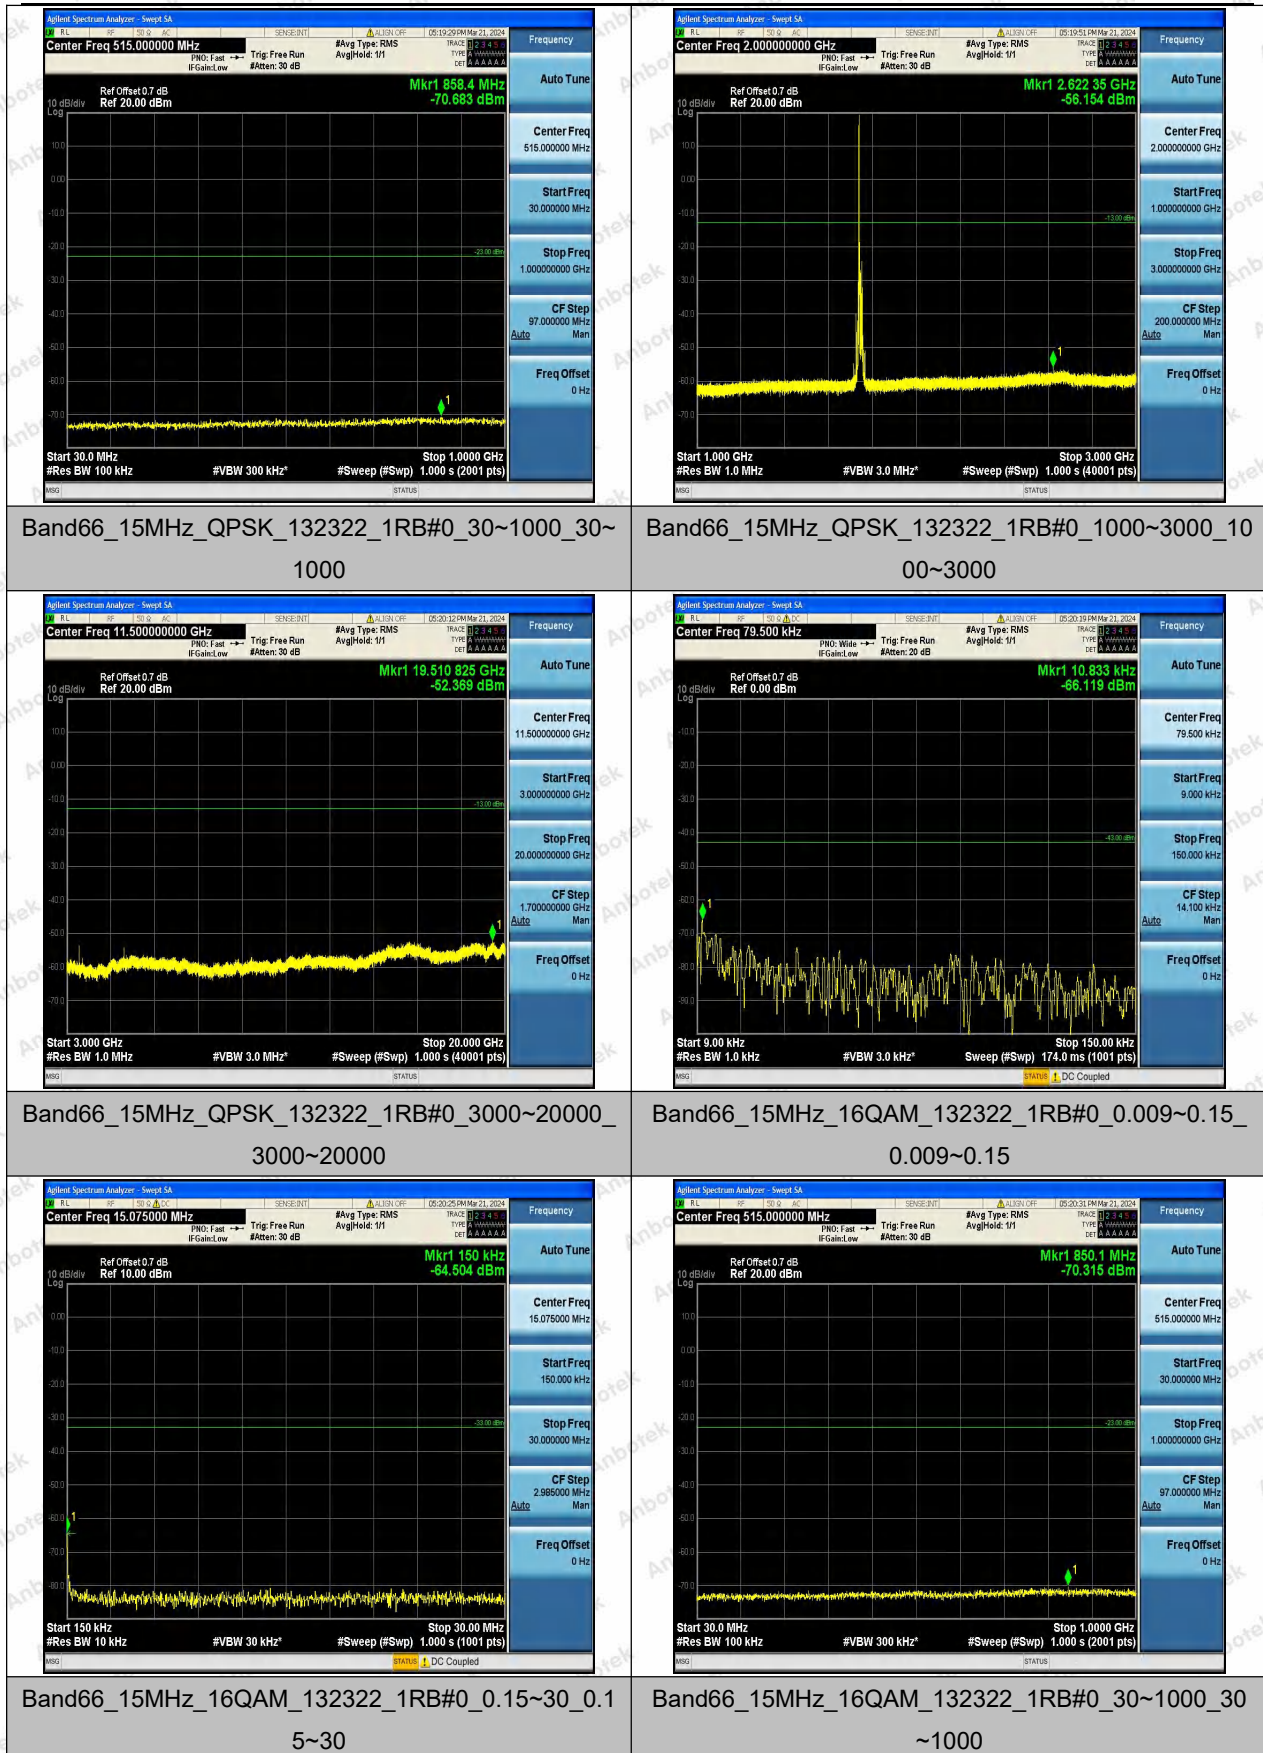

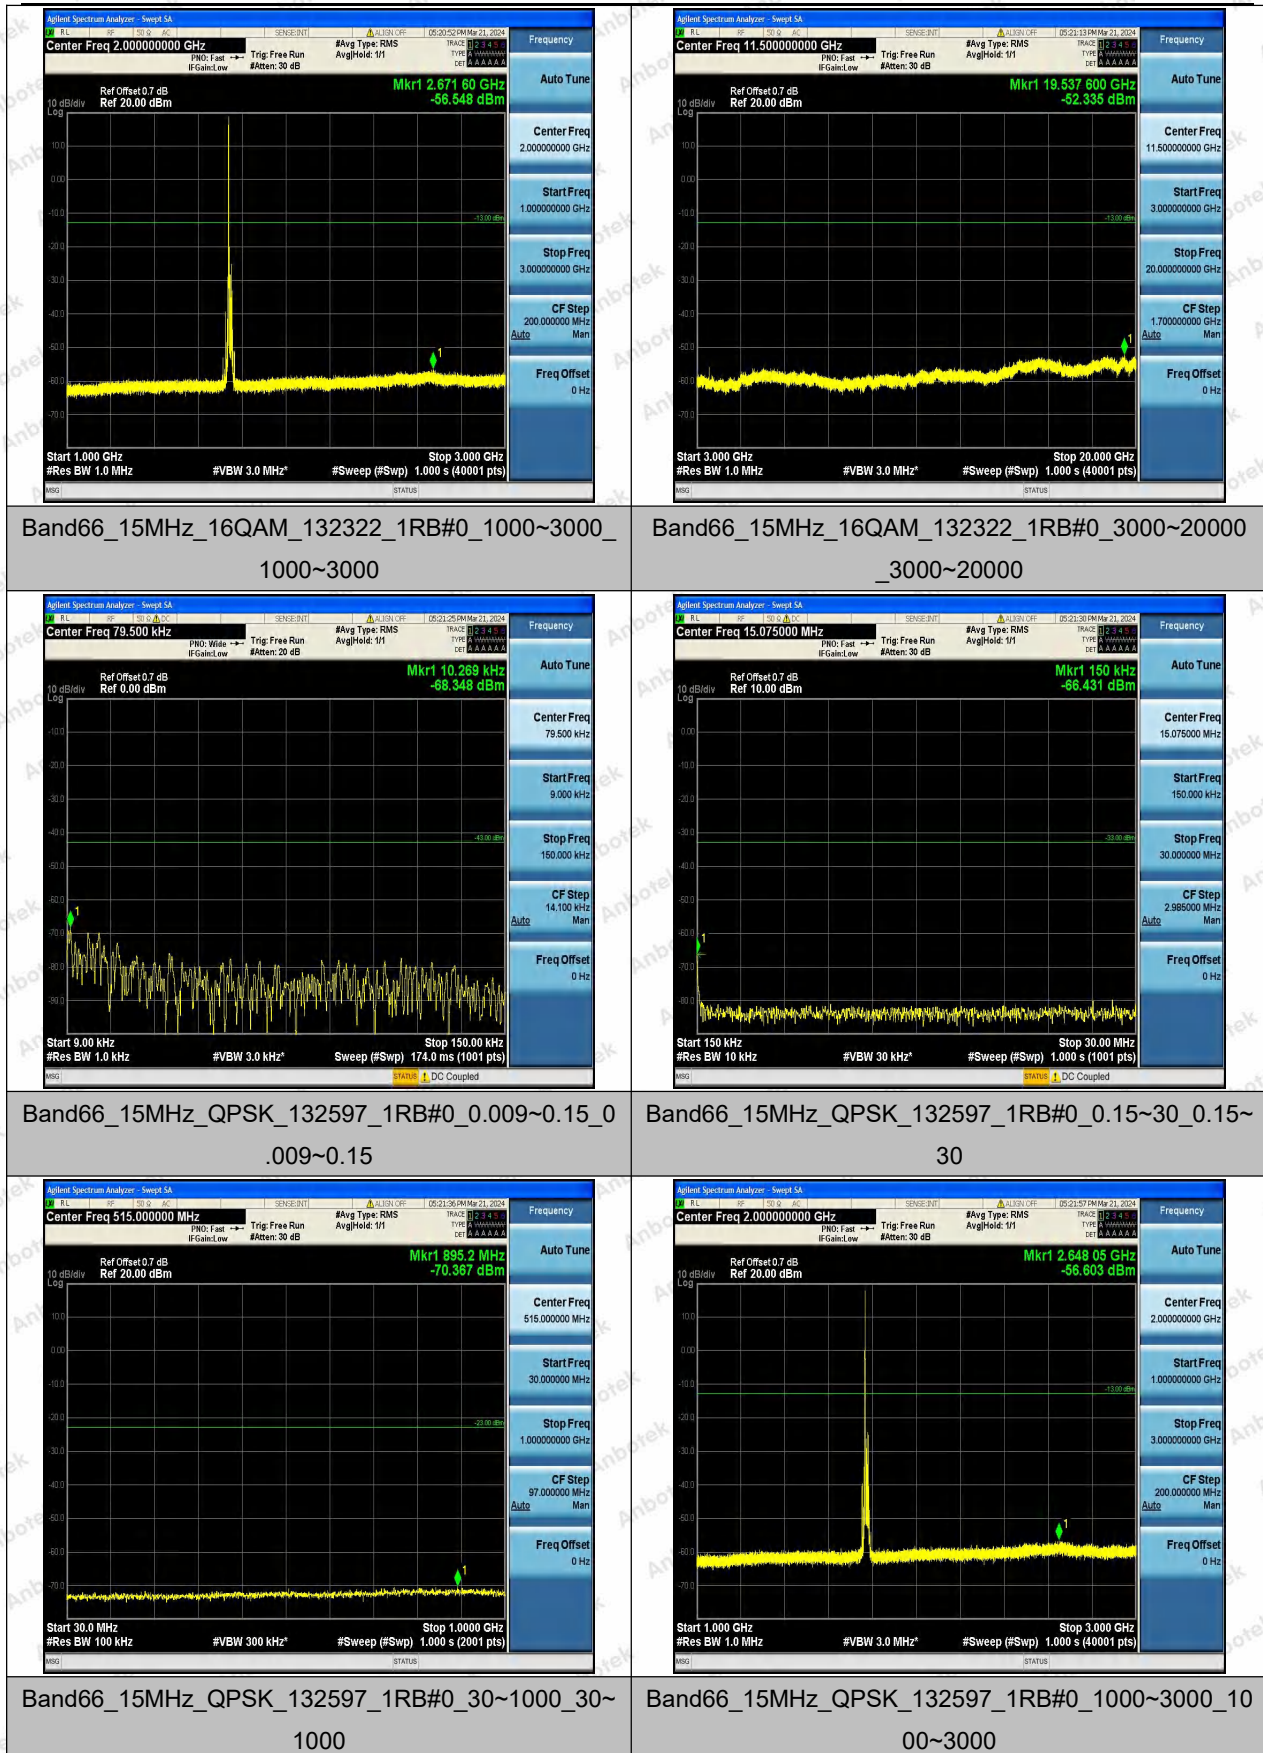

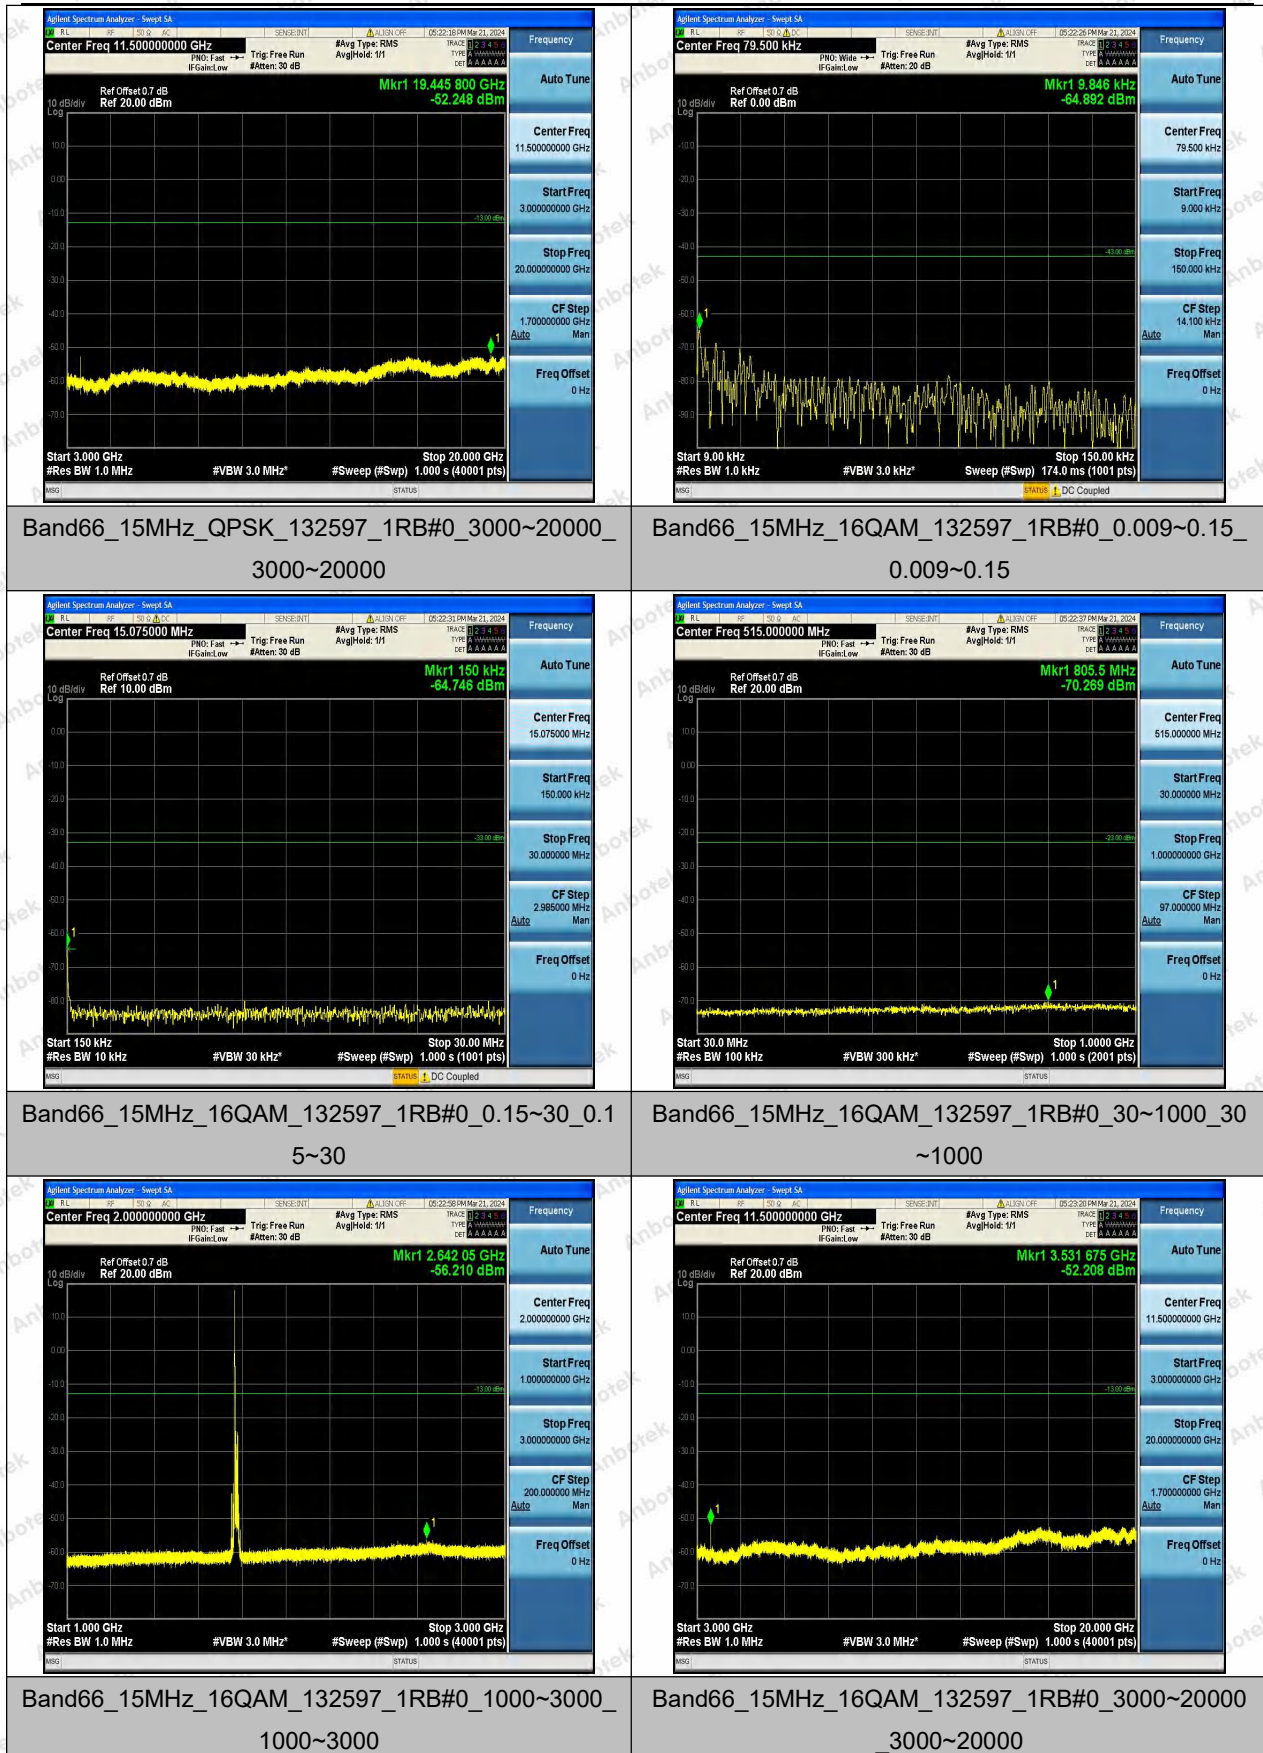

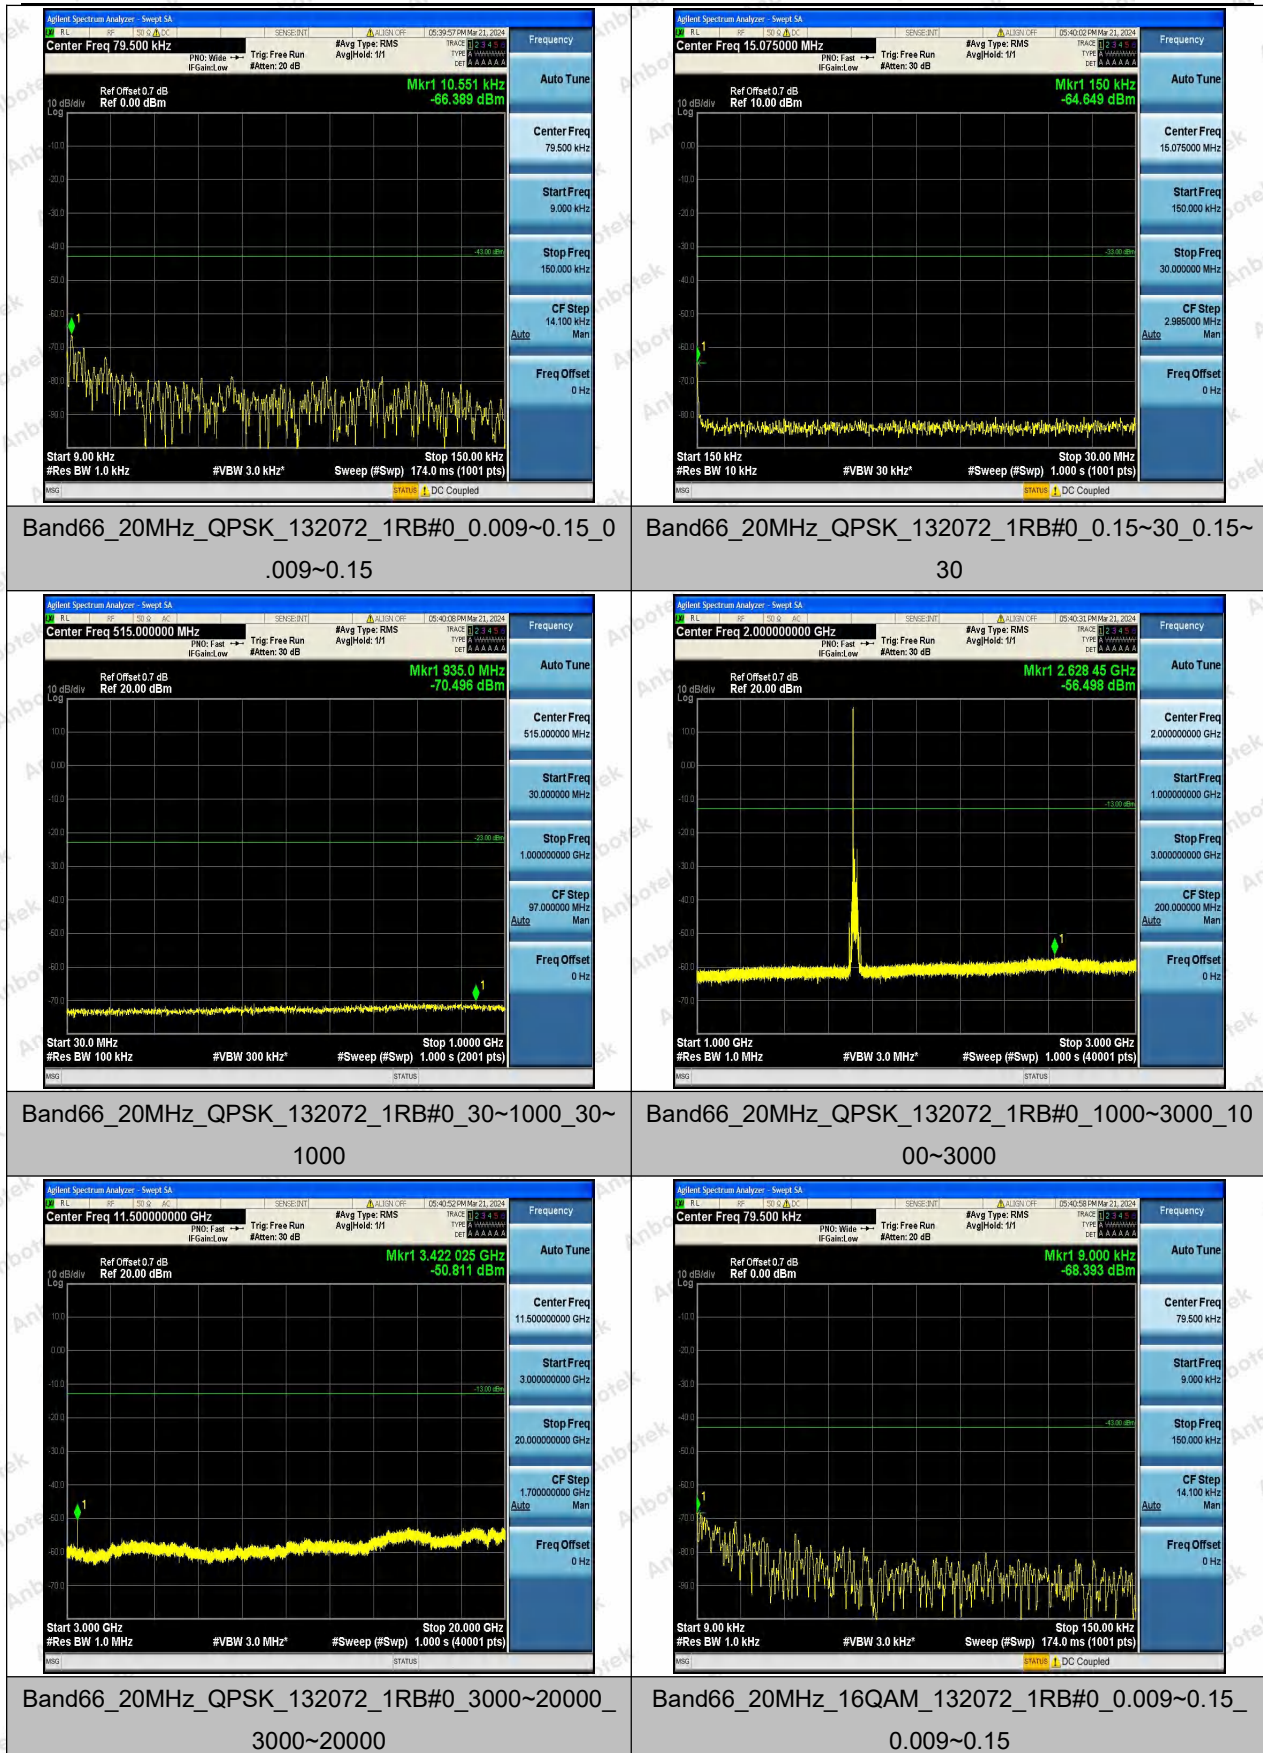


Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



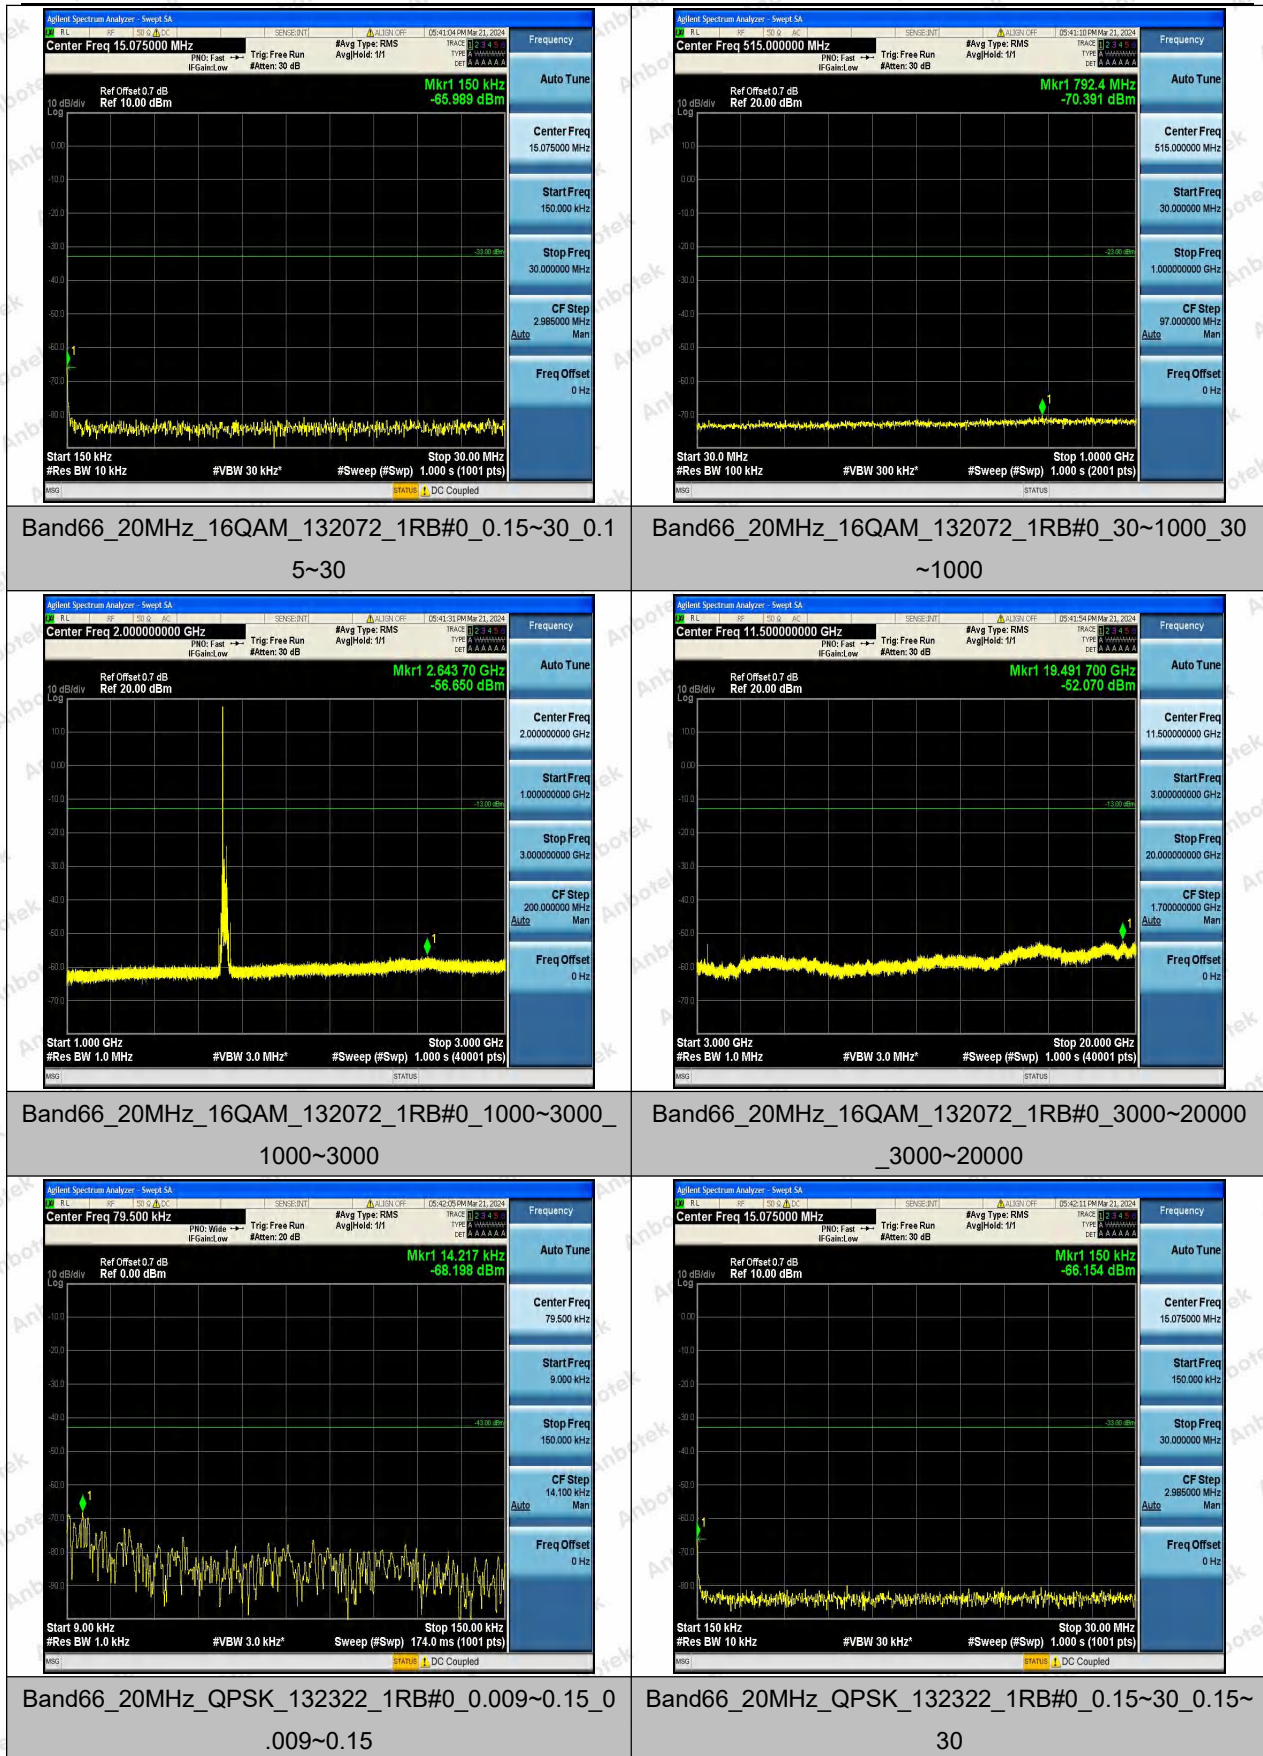

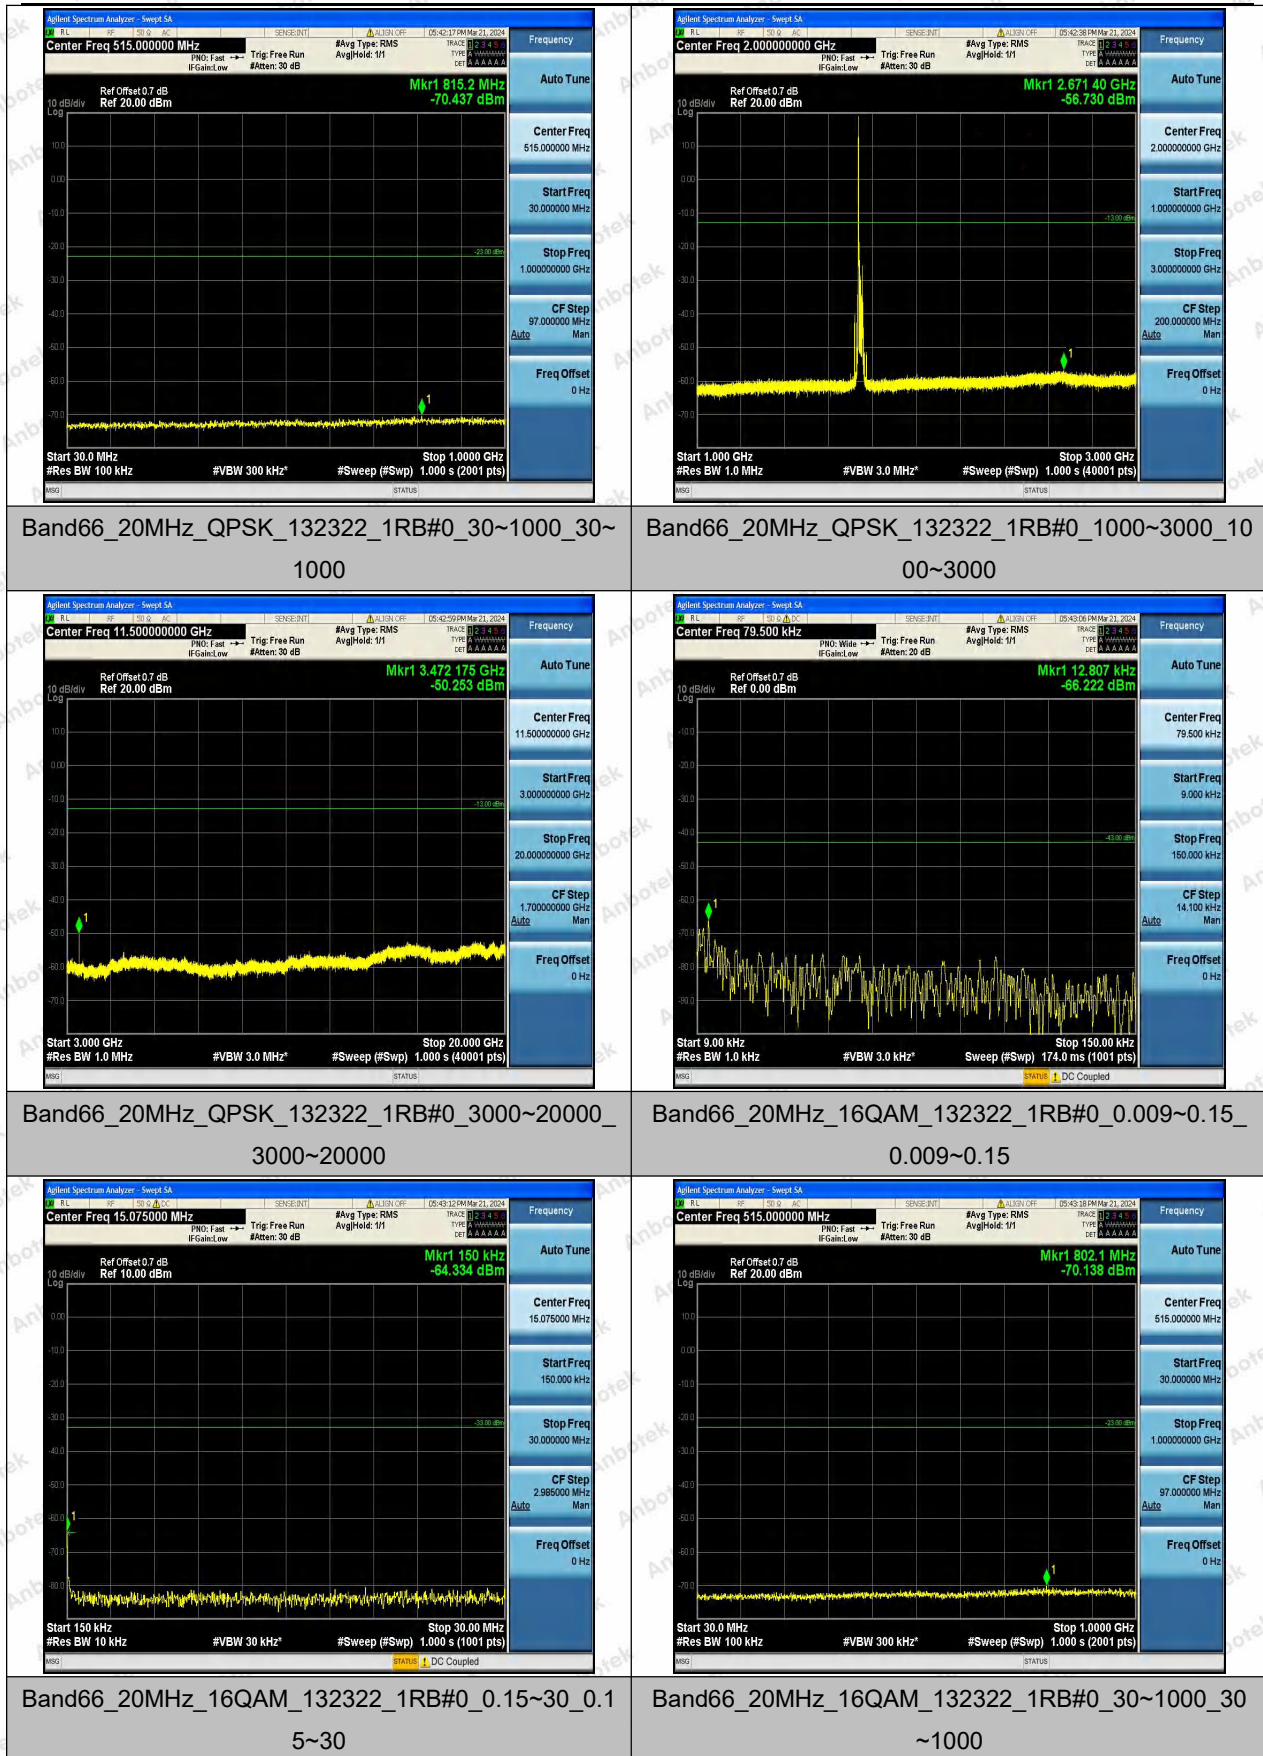


Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



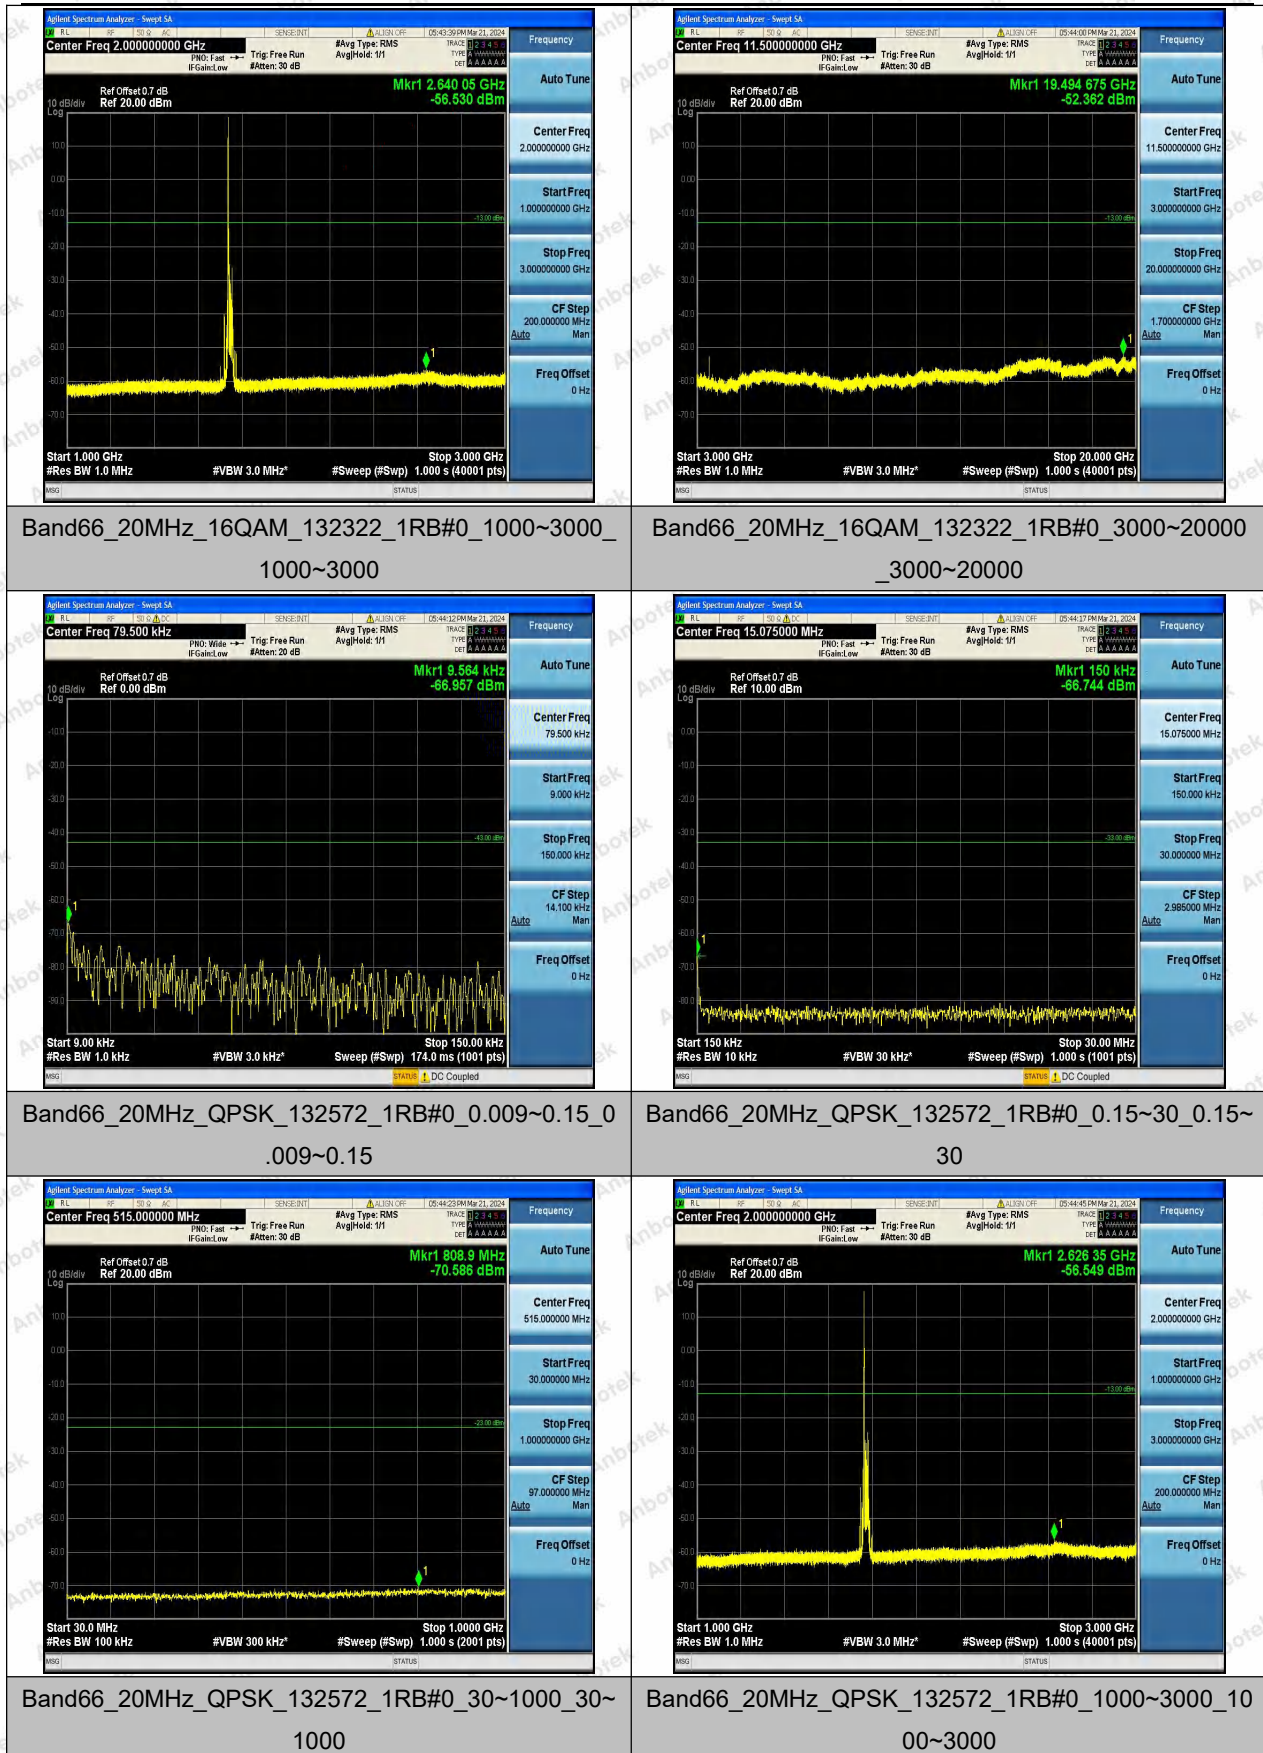

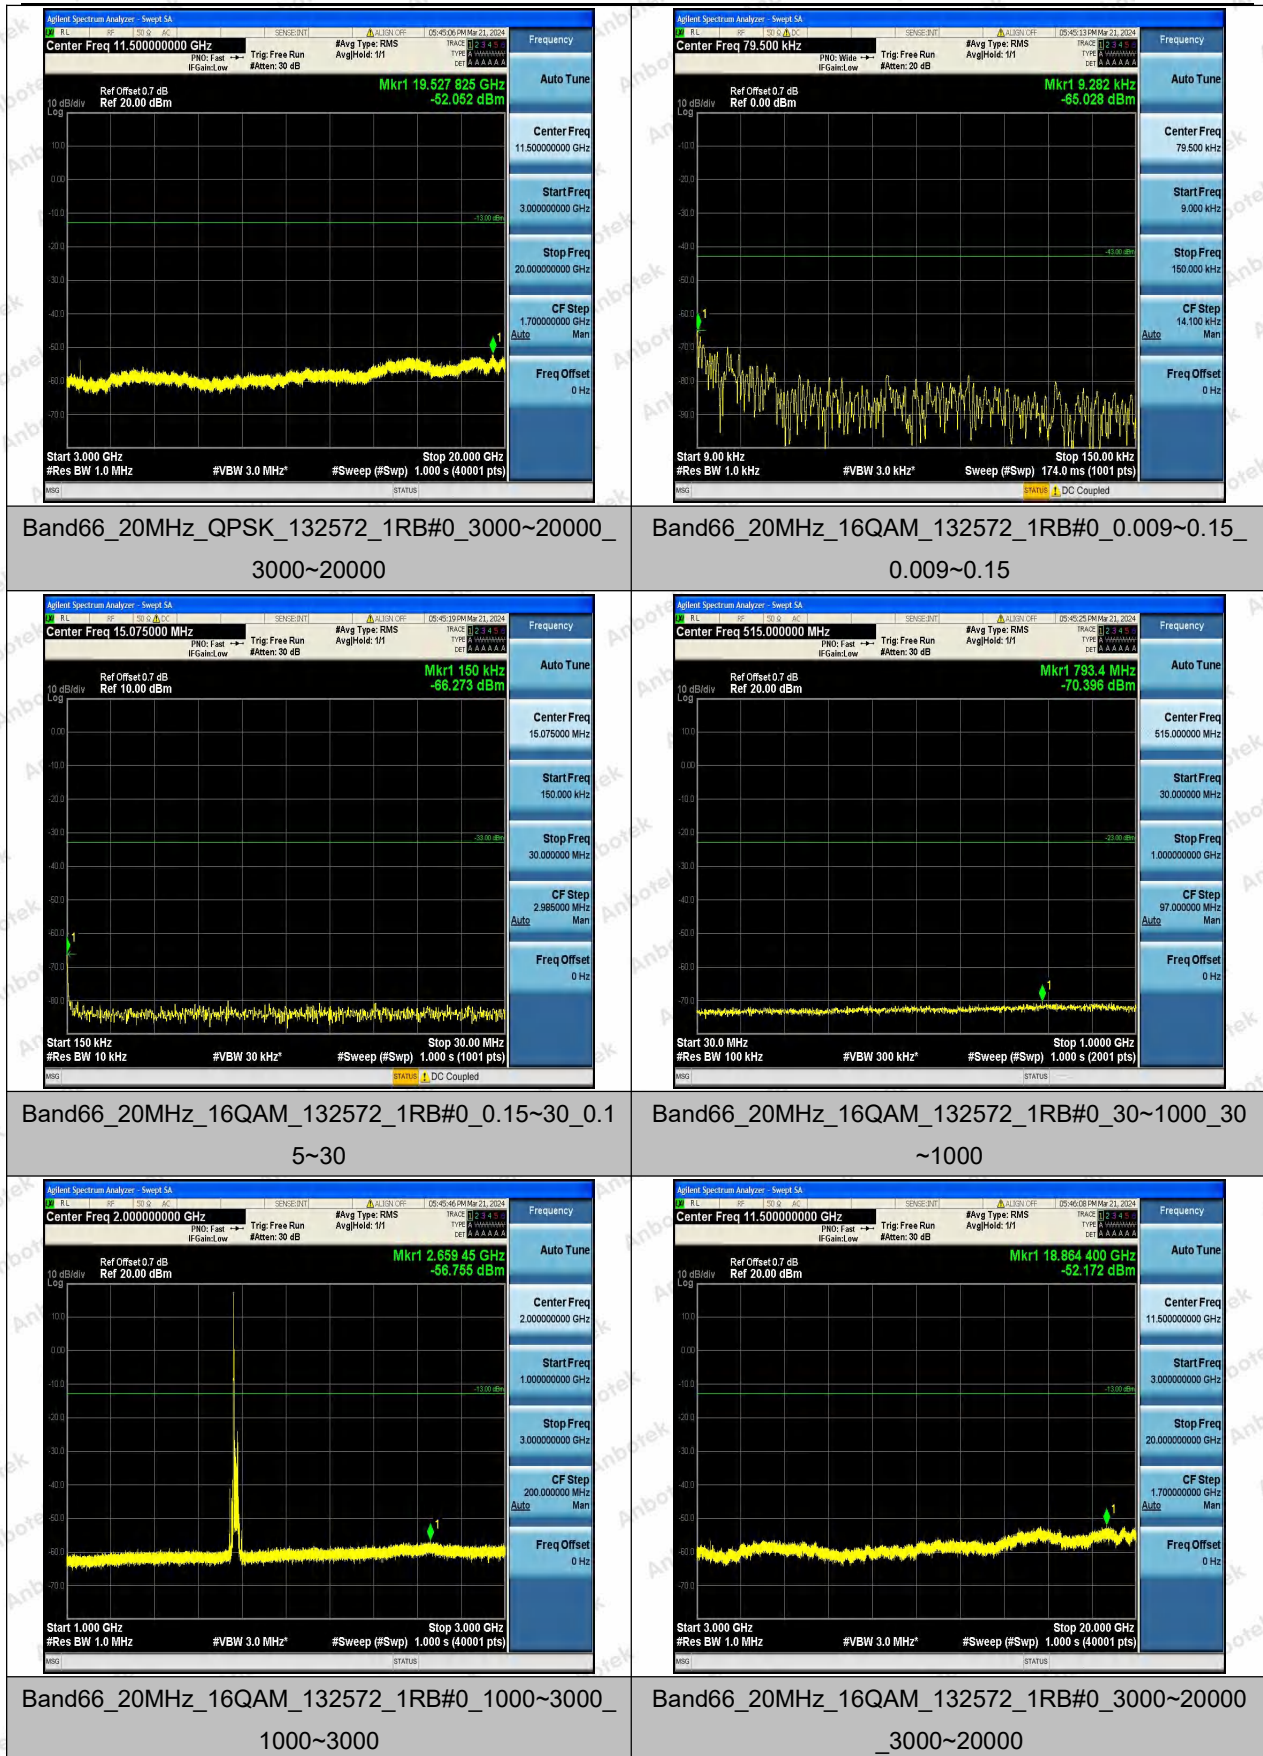

Appendix F: Frequency stability VS Voltage measurement

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage					
					Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band66	3MHz	QPSK	131987	15RB#0	VN	NT	-8.33	-0.004867	±2.5	PASS
Band66	3MHz	QPSK	131987	15RB#0	VL	NT	-6.38	-0.003728	±2.5	PASS
Band66	3MHz	QPSK	131987	15RB#0	VH	NT	-7.18	-0.004195	±2.5	PASS
Band66	3MHz	16QAM	131987	15RB#0	VN	NT	-8.13	-0.004750	±2.5	PASS
Band66	3MHz	16QAM	131987	15RB#0	VL	NT	-6.12	-0.003576	±2.5	PASS
Band66	3MHz	16QAM	131987	15RB#0	VH	NT	-4.03	-0.002355	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	VN	NT	-4.31	-0.002470	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	VL	NT	-6.09	-0.003490	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	VH	NT	-4.95	-0.002837	±2.5	PASS
Band66	3MHz	16QAM	132322	15RB#0	VN	NT	-3.60	-0.002063	±2.5	PASS
Band66	3MHz	16QAM	132322	15RB#0	VL	NT	5.65	0.003238	±2.5	PASS
Band66	3MHz	16QAM	132322	15RB#0	VH	NT	4.16	0.002384	±2.5	PASS
Band66	3MHz	QPSK	132657	15RB#0	VN	NT	-8.35	-0.004695	±2.5	PASS
Band66	3MHz	QPSK	132657	15RB#0	VL	NT	-6.91	-0.003885	±2.5	PASS
Band66	3MHz	QPSK	132657	15RB#0	VH	NT	-6.58	-0.003700	±2.5	PASS
Band66	3MHz	16QAM	132657	15RB#0	VN	NT	-4.55	-0.002558	±2.5	PASS
Band66	3MHz	16QAM	132657	15RB#0	VL	NT	7.24	0.004071	±2.5	PASS
Band66	3MHz	16QAM	132657	15RB#0	VH	NT	-3.20	-0.001799	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	VN	NT	-12.02	-0.007026	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	VL	NT	-10.61	-0.006202	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	VH	NT	-6.65	-0.003887	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	VN	NT	3.86	0.002256	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	VL	NT	-4.72	-0.002759	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	VH	NT	4.32	0.002525	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	VN	NT	-9.28	-0.005318	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	VL	NT	-7.35	-0.004212	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	VH	NT	-7.17	-0.004109	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	VN	NT	-6.94	-0.003977	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	VL	NT	6.64	0.003805	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	VH	NT	5.09	0.002917	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	VN	NT	-8.74	-0.004912	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	VL	NT	-12.82	-0.007205	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	VH	NT	-8.23	-0.004625	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	VN	NT	-4.03	-0.002265	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	VL	NT	8.33	0.004682	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band66	1.4MHz	16QAM	132665	6RB#0	VH	NT	2.07	0.001163	±2.5	PASS
Band66	5MHz	QPSK	131997	25RB#0	VN	NT	-6.35	-0.003708	±2.5	PASS
Band66	5MHz	QPSK	131997	25RB#0	VL	NT	-6.14	-0.003585	±2.5	PASS
Band66	5MHz	QPSK	131997	25RB#0	VH	NT	-7.74	-0.004520	±2.5	PASS
Band66	5MHz	16QAM	131997	25RB#0	VN	NT	6.05	0.003533	±2.5	PASS
Band66	5MHz	16QAM	131997	25RB#0	VL	NT	6.18	0.003609	±2.5	PASS
Band66	5MHz	16QAM	131997	25RB#0	VH	NT	-3.82	-0.002231	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	VN	NT	-6.71	-0.003845	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	VL	NT	-3.99	-0.002287	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	VH	NT	-6.32	-0.003622	±2.5	PASS
Band66	5MHz	16QAM	132322	25RB#0	VN	NT	4.32	0.002476	±2.5	PASS
Band66	5MHz	16QAM	132322	25RB#0	VL	NT	7.85	0.004499	±2.5	PASS
Band66	5MHz	16QAM	132322	25RB#0	VH	NT	-5.98	-0.003427	±2.5	PASS
Band66	5MHz	QPSK	132647	25RB#0	VN	NT	-8.53	-0.004799	±2.5	PASS
Band66	5MHz	QPSK	132647	25RB#0	VL	NT	-4.03	-0.002267	±2.5	PASS
Band66	5MHz	QPSK	132647	25RB#0	VH	NT	-3.30	-0.001857	±2.5	PASS
Band66	5MHz	16QAM	132647	25RB#0	VN	NT	-5.51	-0.003100	±2.5	PASS
Band66	5MHz	16QAM	132647	25RB#0	VL	NT	5.48	0.003083	±2.5	PASS
Band66	5MHz	16QAM	132647	25RB#0	VH	NT	8.74	0.004917	±2.5	PASS
Band66	10MHz	QPSK	132022	50RB#0	VN	NT	-6.61	-0.003854	±2.5	PASS
Band66	10MHz	QPSK	132022	50RB#0	VL	NT	-10.17	-0.005930	±2.5	PASS
Band66	10MHz	QPSK	132022	50RB#0	VH	NT	-7.10	-0.004140	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	VN	NT	5.99	0.003433	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	VL	NT	-8.20	-0.004699	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	VH	NT	-7.20	-0.004126	±2.5	PASS
Band66	10MHz	QPSK	132622	50RB#0	VN	NT	6.67	0.003758	±2.5	PASS
Band66	10MHz	QPSK	132622	50RB#0	VL	NT	-4.96	-0.002794	±2.5	PASS
Band66	10MHz	QPSK	132622	50RB#0	VH	NT	-5.06	-0.002851	±2.5	PASS
Band66	15MHz	QPSK	132047	75RB#0	VN	NT	-11.00	-0.006405	±2.5	PASS
Band66	15MHz	QPSK	132047	75RB#0	VL	NT	-6.24	-0.003633	±2.5	PASS
Band66	15MHz	QPSK	132047	75RB#0	VH	NT	-7.50	-0.004367	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	VN	NT	8.51	0.004877	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	VL	NT	-9.60	-0.005501	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	VH	NT	-8.60	-0.004928	±2.5	PASS
Band66	15MHz	QPSK	132597	75RB#0	VN	NT	6.97	0.003932	±2.5	PASS
Band66	15MHz	QPSK	132597	75RB#0	VL	NT	-4.79	-0.002702	±2.5	PASS
Band66	15MHz	QPSK	132597	75RB#0	VH	NT	-8.67	-0.004891	±2.5	PASS
Band66	20MHz	QPSK	132072	100RB#0	VN	NT	-8.41	-0.004890	±2.5	PASS
Band66	20MHz	QPSK	132072	100RB#0	VL	NT	-7.32	-0.004256	±2.5	PASS
Band66	20MHz	QPSK	132072	100RB#0	VH	NT	-4.68	-0.002721	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	VN	NT	3.99	0.002287	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Band66	20MHz	QPSK	132322	100RB#0	VL	NT	-5.34	-0.003060	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	VH	NT	-7.85	-0.004499	±2.5	PASS
Band66	20MHz	QPSK	132572	100RB#0	VN	NT	8.50	0.004802	±2.5	PASS
Band66	20MHz	QPSK	132572	100RB#0	VL	NT	-8.98	-0.005073	±2.5	PASS
Band66	20MHz	QPSK	132572	100RB#0	VH	NT	-6.72	-0.003797	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix G: Frequency stability VS Temperature measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band66	3MHz	QPSK	131987	15RB#0	NV	-30	5.46	0.003190	±2.5	PASS
Band66	3MHz	QPSK	131987	15RB#0	NV	-20	-6.78	-0.003961	±2.5	PASS
Band66	3MHz	QPSK	131987	15RB#0	NV	-10	-7.67	-0.004481	±2.5	PASS
Band66	3MHz	QPSK	131987	15RB#0	NV	0	-9.96	-0.005819	±2.5	PASS
Band66	3MHz	QPSK	131987	15RB#0	NV	10	-5.39	-0.003149	±2.5	PASS
Band66	3MHz	QPSK	131987	15RB#0	NV	20	-5.32	-0.003108	±2.5	PASS
Band66	3MHz	QPSK	131987	15RB#0	NV	30	-5.24	-0.003062	±2.5	PASS
Band66	3MHz	QPSK	131987	15RB#0	NV	40	-6.17	-0.003605	±2.5	PASS
Band66	3MHz	QPSK	131987	15RB#0	NV	50	-6.74	-0.003938	±2.5	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	-30	-5.25	-0.003067	±2.5	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	-20	4.12	0.002407	±2.5	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	-10	-5.94	-0.003471	±2.5	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	0	-4.08	-0.002384	±2.5	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	10	8.37	0.004890	±2.5	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	20	3.86	0.002255	±2.5	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	30	3.63	0.002121	±2.5	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	40	5.21	0.003044	±2.5	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	50	-4.09	-0.002390	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	-30	-5.85	-0.003352	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	-20	-6.07	-0.003479	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	-10	5.49	0.003146	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	0	-6.75	-0.003868	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	10	-8.71	-0.004991	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	20	8.67	0.004968	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	30	-3.48	-0.001994	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	40	-7.02	-0.004023	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	50	-9.93	-0.005691	±2.5	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	-30	-3.38	-0.001937	±2.5	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	-20	3.72	0.002132	±2.5	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	-10	-2.29	-0.001312	±2.5	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	0	-5.59	-0.003203	±2.5	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	10	-5.98	-0.003427	±2.5	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	20	-5.04	-0.002888	±2.5	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	30	5.85	0.003352	±2.5	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	40	3.65	0.002092	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band66	3MHz	16QAM	132322	15RB#0	NV	50	-5.01	-0.002871	±2.5	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	-30	-6.47	-0.003638	±2.5	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	-20	-8.34	-0.004689	±2.5	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	-10	-6.47	-0.003638	±2.5	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	0	4.22	0.002373	±2.5	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	10	-3.95	-0.002221	±2.5	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	20	6.58	0.003700	±2.5	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	30	-4.63	-0.002603	±2.5	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	40	7.15	0.004020	±2.5	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	50	5.41	0.003042	±2.5	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	-30	-3.75	-0.002109	±2.5	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	-20	7.62	0.004285	±2.5	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	-10	-6.64	-0.003733	±2.5	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	0	3.09	0.001737	±2.5	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	10	5.11	0.002873	±2.5	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	20	6.08	0.003419	±2.5	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	30	-5.84	-0.003284	±2.5	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	40	4.26	0.002395	±2.5	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	50	5.54	0.003115	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	NV	-30	-5.46	-0.003192	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	NV	-20	-7.21	-0.004215	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	NV	-10	-7.68	-0.004489	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	NV	0	-10.06	-0.005881	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	NV	10	-4.71	-0.002753	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	NV	20	-9.27	-0.005419	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	NV	30	-6.35	-0.003712	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	NV	40	4.16	0.002432	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	NV	50	-9.01	-0.005267	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	-30	3.78	0.002210	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	-20	3.88	0.002268	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	-10	-4.46	-0.002607	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	0	-4.15	-0.002426	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	10	3.86	0.002256	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	20	-6.28	-0.003671	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	30	-4.94	-0.002888	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	40	-8.54	-0.004992	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	50	-5.92	-0.003461	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	-30	-9.74	-0.005582	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	-20	-8.51	-0.004877	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	-10	-6.92	-0.003966	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	0	-6.78	-0.003885	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band66	1.4MHz	QPSK	132322	6RB#0	NV	10	-6.95	-0.003983	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	20	-5.22	-0.002991	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	30	-7.65	-0.004384	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	40	-6.07	-0.003479	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	50	-9.47	-0.005427	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	-30	-8.25	-0.004728	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	-20	-6.87	-0.003937	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	-10	-6.67	-0.003822	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	0	-8.28	-0.004745	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	10	3.98	0.002281	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	20	-4.19	-0.002401	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	30	-6.22	-0.003564	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	40	5.46	0.003129	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	50	6.45	0.003696	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	-30	-9.84	-0.005530	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	-20	-7.94	-0.004462	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	-10	-7.97	-0.004479	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	0	-5.52	-0.003102	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	10	-4.62	-0.002597	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	20	-5.72	-0.003215	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	30	-5.64	-0.003170	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	40	-5.26	-0.002956	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	50	-4.39	-0.002467	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	-30	4.65	0.002613	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	-20	-4.48	-0.002518	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	-10	6.27	0.003524	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	0	8.03	0.004513	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	10	4.33	0.002434	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	20	-5.02	-0.002821	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	30	-4.06	-0.002282	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	40	2.10	0.001180	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	50	-4.84	-0.002720	±2.5	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	-30	-5.25	-0.003066	±2.5	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	-20	-8.40	-0.004905	±2.5	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	-10	3.43	0.002003	±2.5	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	0	-4.89	-0.002855	±2.5	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	10	-7.30	-0.004263	±2.5	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	20	4.56	0.002663	±2.5	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	30	-5.54	-0.003235	±2.5	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	40	-8.15	-0.004759	±2.5	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	50	-5.31	-0.003101	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Band66	5MHz	16QAM	131997	25RB#0	NV	-30	4.85	0.002832	±2.5	PASS
Band66	5MHz	16QAM	131997	25RB#0	NV	-20	4.99	0.002914	±2.5	PASS
Band66	5MHz	16QAM	131997	25RB#0	NV	-10	-3.96	-0.002312	±2.5	PASS
Band66	5MHz	16QAM	131997	25RB#0	NV	0	-6.28	-0.003667	±2.5	PASS
Band66	5MHz	16QAM	131997	25RB#0	NV	10	2.85	0.001664	±2.5	PASS
Band66	5MHz	16QAM	131997	25RB#0	NV	20	-5.58	-0.003258	±2.5	PASS
Band66	5MHz	16QAM	131997	25RB#0	NV	30	-7.44	-0.004345	±2.5	PASS
Band66	5MHz	16QAM	131997	25RB#0	NV	40	5.54	0.003235	±2.5	PASS
Band66	5MHz	16QAM	131997	25RB#0	NV	50	5.64	0.003293	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	-30	-8.53	-0.004888	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	-20	-8.10	-0.004642	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	-10	-5.56	-0.003186	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	0	-2.99	-0.001713	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	10	-8.18	-0.004688	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	20	3.91	0.002241	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	30	-5.31	-0.003043	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	40	5.18	0.002968	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	50	7.57	0.004338	±2.5	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	-30	-3.05	-0.001748	±2.5	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	-20	-5.28	-0.003026	±2.5	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	-10	6.47	0.003708	±2.5	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	0	2.19	0.001255	±2.5	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	10	-2.59	-0.001484	±2.5	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	20	6.49	0.003719	±2.5	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	30	-5.76	-0.003301	±2.5	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	40	-5.01	-0.002871	±2.5	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	50	-6.52	-0.003736	±2.5	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	-30	-4.05	-0.002278	±2.5	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	-20	10.74	0.006042	±2.5	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	-10	-8.63	-0.004855	±2.5	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	0	-5.82	-0.003274	±2.5	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	10	-4.84	-0.002723	±2.5	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	20	6.31	0.003550	±2.5	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	30	-4.63	-0.002605	±2.5	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	40	5.41	0.003044	±2.5	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	50	-3.73	-0.002098	±2.5	PASS
Band66	5MHz	16QAM	132647	25RB#0	NV	-30	-3.96	-0.002228	±2.5	PASS
Band66	5MHz	16QAM	132647	25RB#0	NV	-20	4.68	0.002633	±2.5	PASS
Band66	5MHz	16QAM	132647	25RB#0	NV	-10	3.62	0.002037	±2.5	PASS
Band66	5MHz	16QAM	132647	25RB#0	NV	0	4.94	0.002779	±2.5	PASS
Band66	5MHz	16QAM	132647	25RB#0	NV	10	6.02	0.003387	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Band66	5MHz	16QAM	132647	25RB#0	NV	20	-4.95	-0.002785	±2.5	PASS
Band66	5MHz	16QAM	132647	25RB#0	NV	30	6.75	0.003797	±2.5	PASS
Band66	5MHz	16QAM	132647	25RB#0	NV	40	-6.21	-0.003494	±2.5	PASS
Band66	5MHz	16QAM	132647	25RB#0	NV	50	6.59	0.003707	±2.5	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	-30	-8.05	-0.004694	±2.5	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	-20	-4.99	-0.002910	±2.5	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	-10	-7.45	-0.004344	±2.5	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	0	-8.27	-0.004822	±2.5	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	10	-9.00	-0.005248	±2.5	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	20	-5.64	-0.003289	±2.5	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	30	-6.58	-0.003837	±2.5	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	40	-2.93	-0.001708	±2.5	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	50	5.64	0.003289	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	-30	-6.29	-0.003605	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	-20	-3.89	-0.002229	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	-10	-4.82	-0.002762	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	0	-7.75	-0.004441	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	10	-4.58	-0.002625	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	20	3.18	0.001822	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	30	-3.98	-0.002281	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	40	-4.89	-0.002802	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	50	5.52	0.003163	±2.5	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	-30	-7.72	-0.004349	±2.5	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	-20	2.95	0.001662	±2.5	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	-10	-5.68	-0.003200	±2.5	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	0	-7.67	-0.004321	±2.5	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	10	5.61	0.003161	±2.5	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	20	8.15	0.004592	±2.5	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	30	-3.69	-0.002079	±2.5	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	40	6.92	0.003899	±2.5	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	50	-7.05	-0.003972	±2.5	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	-30	-5.64	-0.003284	±2.5	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	-20	-5.19	-0.003022	±2.5	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	-10	-7.42	-0.004320	±2.5	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	0	-6.48	-0.003773	±2.5	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	10	8.07	0.004699	±2.5	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	20	-6.44	-0.003750	±2.5	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	30	3.23	0.001881	±2.5	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	40	5.49	0.003197	±2.5	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	50	-5.34	-0.003109	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	-30	4.78	0.002739	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Band66	15MHz	QPSK	132322	75RB#0	NV	-20	-5.69	-0.003261	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	-10	-3.69	-0.002115	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	0	4.79	0.002745	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	10	6.45	0.003696	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	20	-7.84	-0.004493	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	30	-4.52	-0.002590	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	40	3.39	0.001943	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	50	-8.07	-0.004625	±2.5	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	-30	5.36	0.003024	±2.5	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	-20	-9.13	-0.005151	±2.5	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	-10	6.77	0.003819	±2.5	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	0	-7.44	-0.004197	±2.5	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	10	4.28	0.002415	±2.5	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	20	-4.22	-0.002381	±2.5	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	30	-5.06	-0.002855	±2.5	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	40	-6.57	-0.003707	±2.5	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	50	-4.78	-0.002697	±2.5	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	-30	-6.48	-0.003767	±2.5	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	-20	-8.47	-0.004924	±2.5	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	-10	-5.89	-0.003424	±2.5	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	0	-5.64	-0.003279	±2.5	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	10	-6.02	-0.003500	±2.5	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	20	-5.02	-0.002919	±2.5	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	30	4.23	0.002459	±2.5	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	40	6.68	0.003884	±2.5	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	50	5.88	0.003419	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	-30	-8.58	-0.004917	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	-20	-6.08	-0.003484	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	-10	-3.55	-0.002034	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	0	-3.59	-0.002057	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	10	-5.26	-0.003014	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	20	-3.89	-0.002229	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	30	5.14	0.002946	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	40	-3.52	-0.002017	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	50	-6.75	-0.003868	±2.5	PASS
Band66	20MHz	QPSK	132572	100RB#0	NV	-30	-7.34	-0.004147	±2.5	PASS
Band66	20MHz	QPSK	132572	100RB#0	NV	-20	-7.08	-0.004000	±2.5	PASS
Band66	20MHz	QPSK	132572	100RB#0	NV	-10	-4.94	-0.002791	±2.5	PASS
Band66	20MHz	QPSK	132572	100RB#0	NV	0	6.21	0.003508	±2.5	PASS
Band66	20MHz	QPSK	132572	100RB#0	NV	10	-4.18	-0.002362	±2.5	PASS
Band66	20MHz	QPSK	132572	100RB#0	NV	20	-4.88	-0.002757	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Band66	20MHz	QPSK	132572	100RB#0	NV	30	-5.02	-0.002836	±2.5	PASS
Band66	20MHz	QPSK	132572	100RB#0	NV	40	-5.88	-0.003322	±2.5	PASS
Band66	20MHz	QPSK	132572	100RB#0	NV	50	-7.17	-0.004051	±2.5	PASS

---END---

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn

