




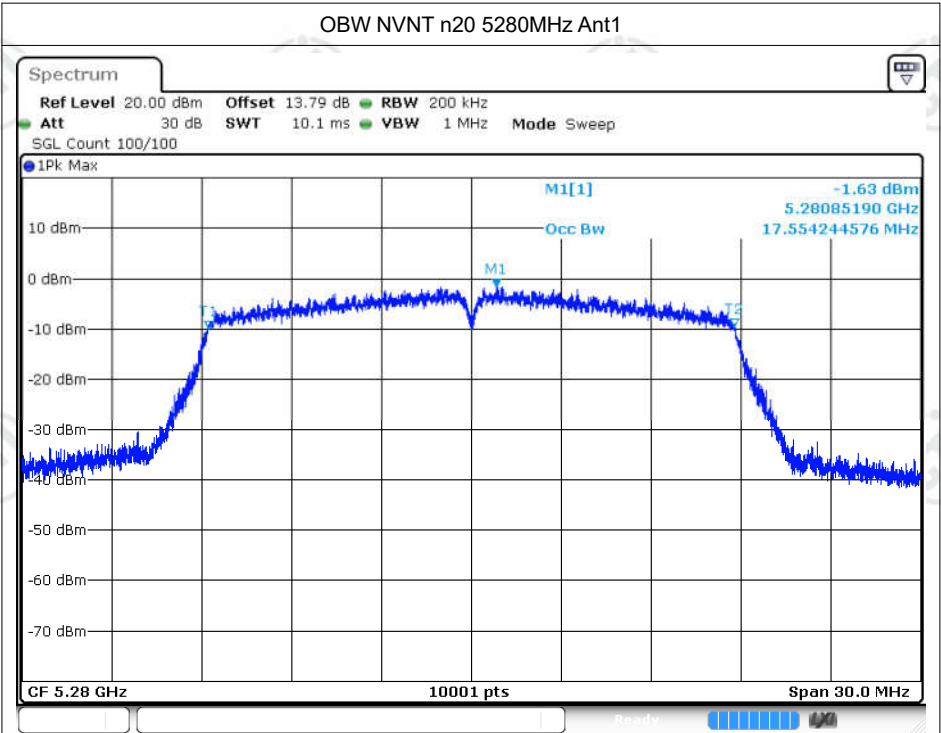


Date: 5.MAY.2024 13:00:52

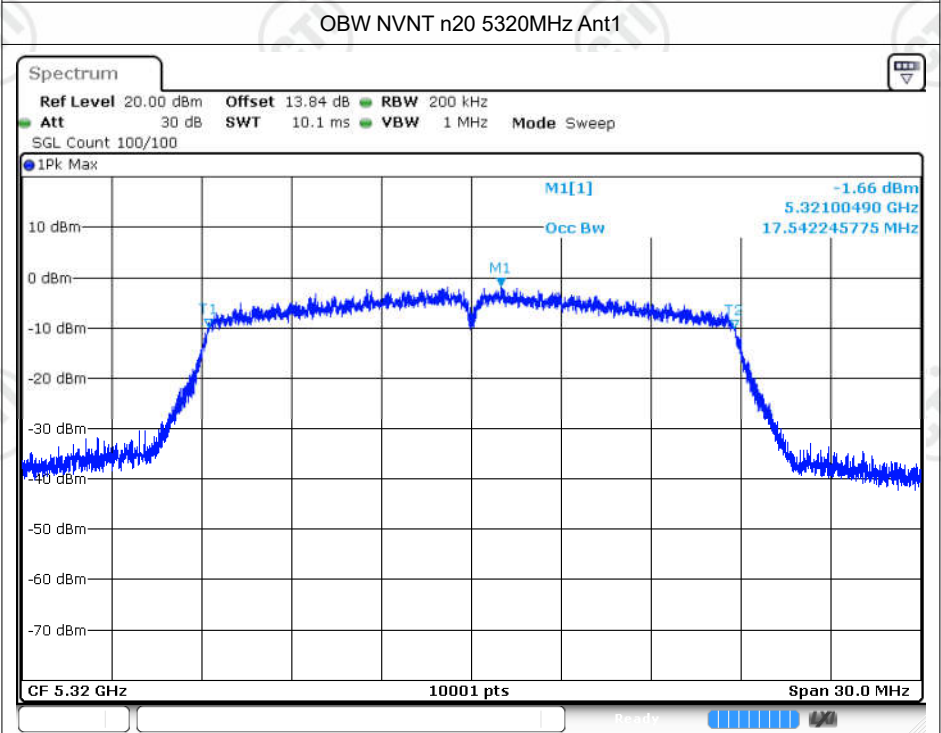


Date: 5.MAY.2024 13:02:47

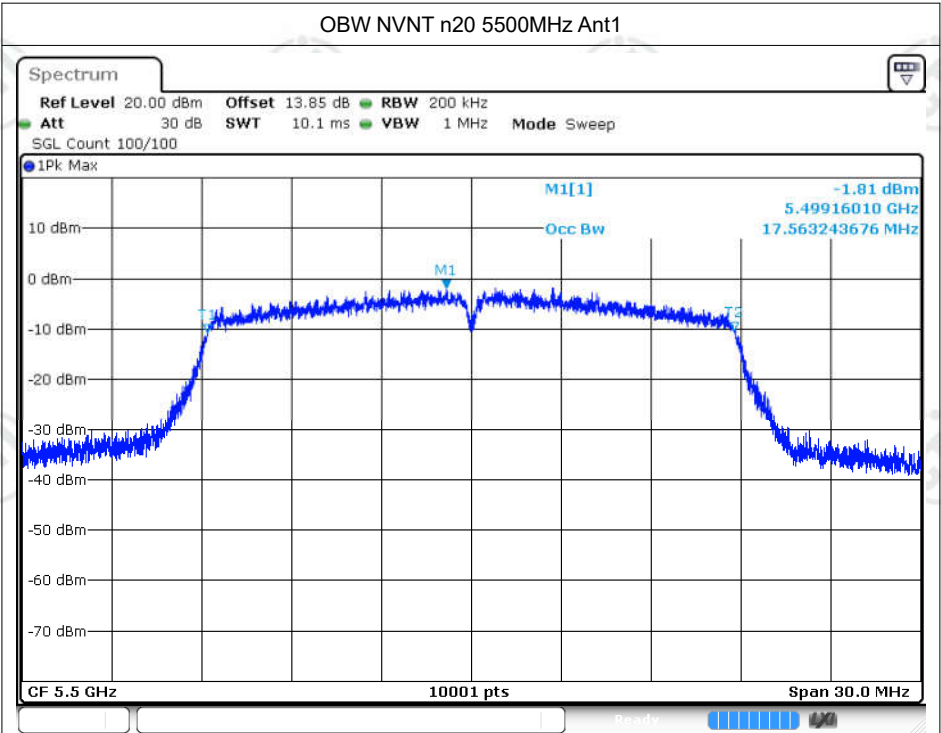


Date: 5.MAY.2024 13:04:32

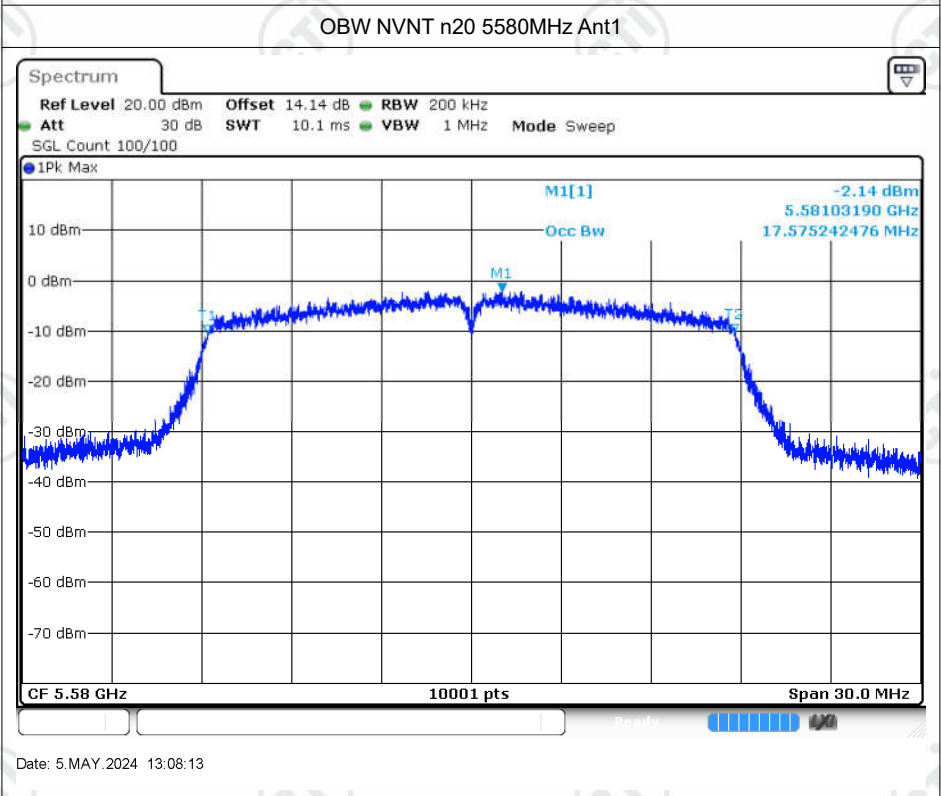


Date: 5.MAY.2024 13:08:13

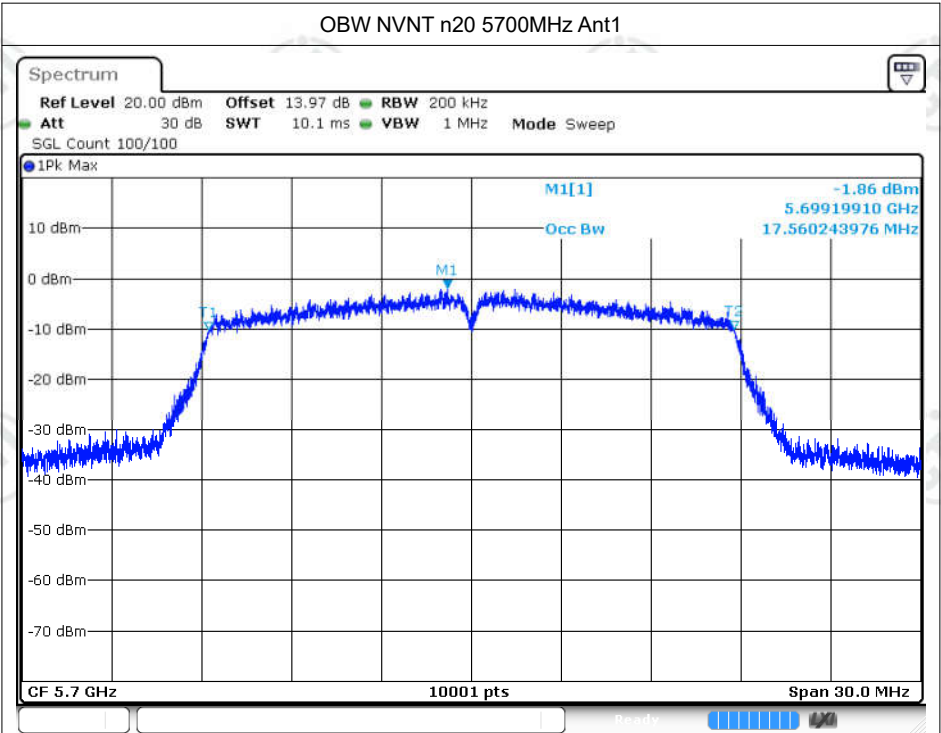


Date: 5.MAY.2024 13:06:57

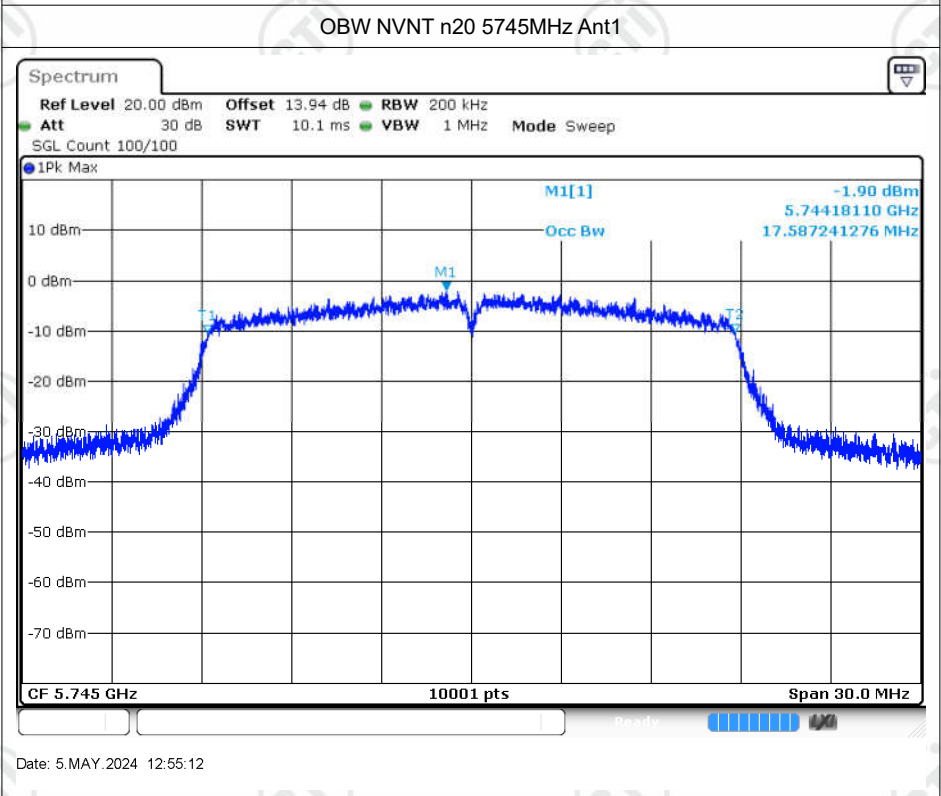


Date: 5.MAY.2024 12:55:12

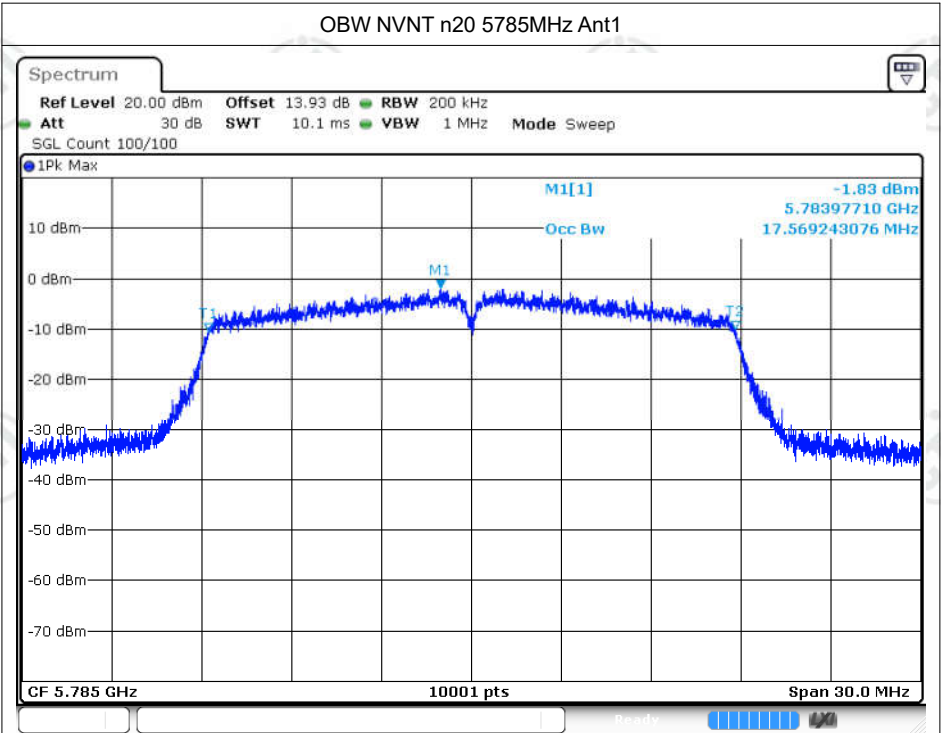


Date: 5.MAY.2024 12:56:43

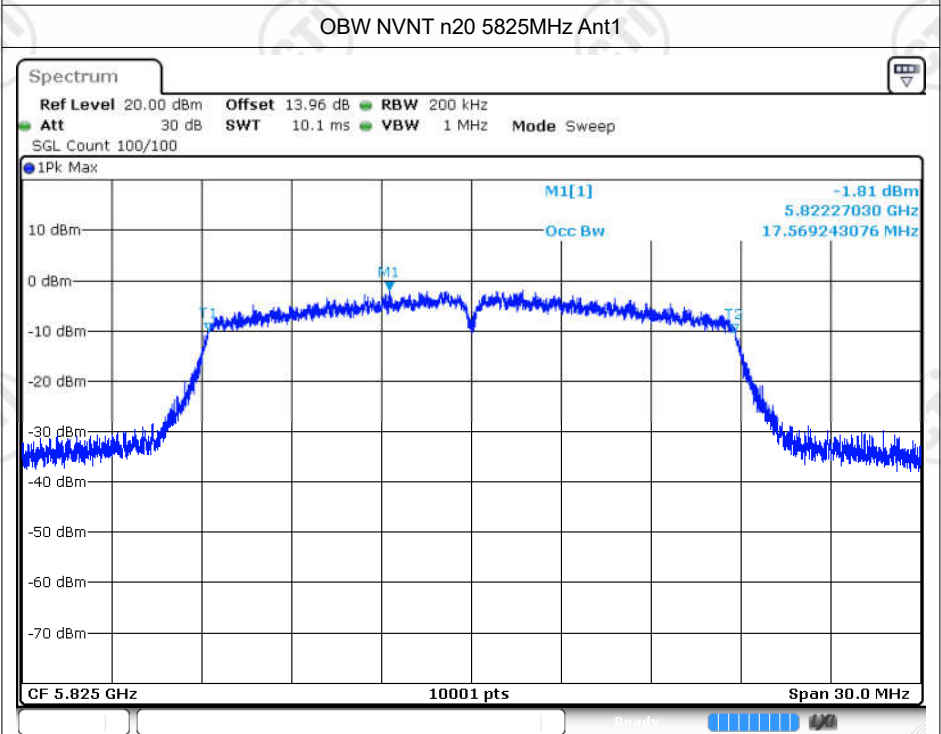


Date: 5.MAY.2024 12:57:43

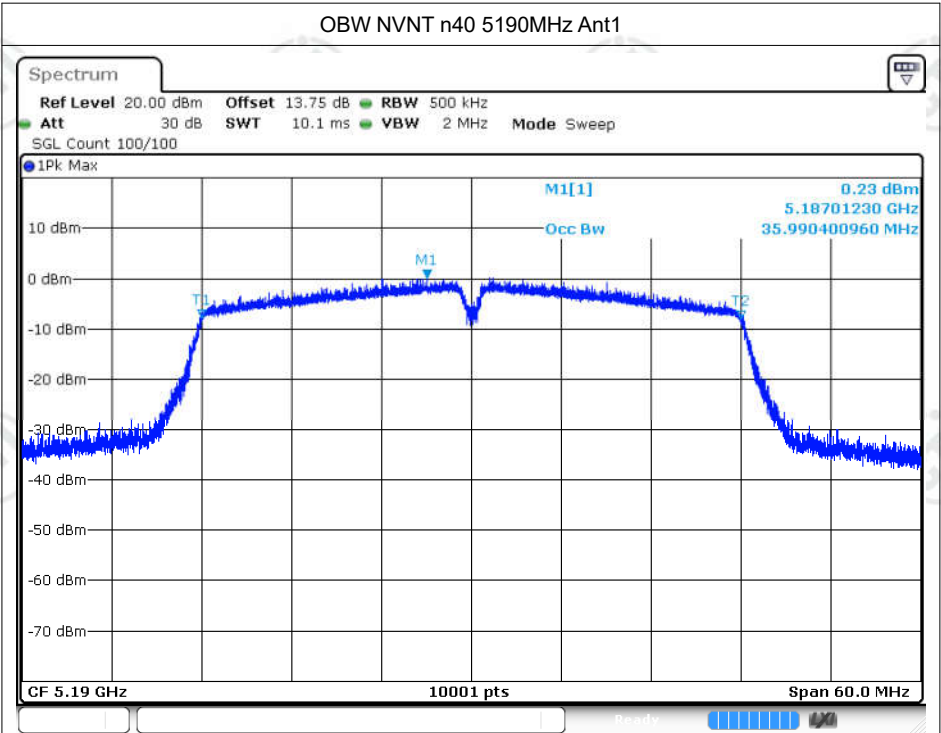


Date: 5.MAY.2024 13:10:25

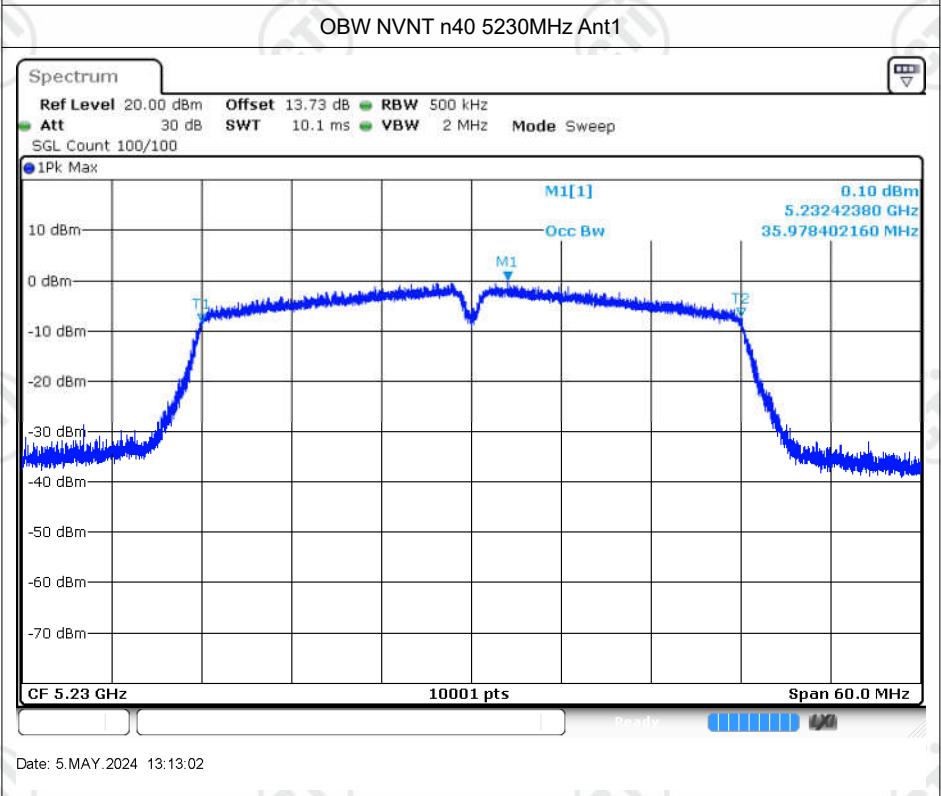


Date: 5.MAY.2024 13:13:02

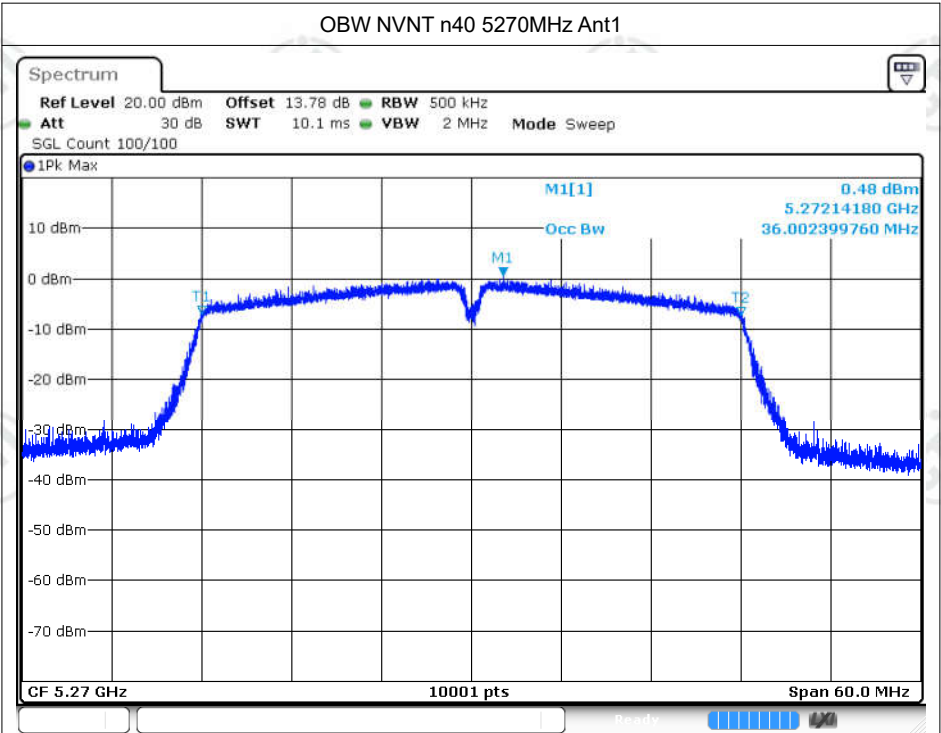


Date: 5.MAY.2024 13:18:28

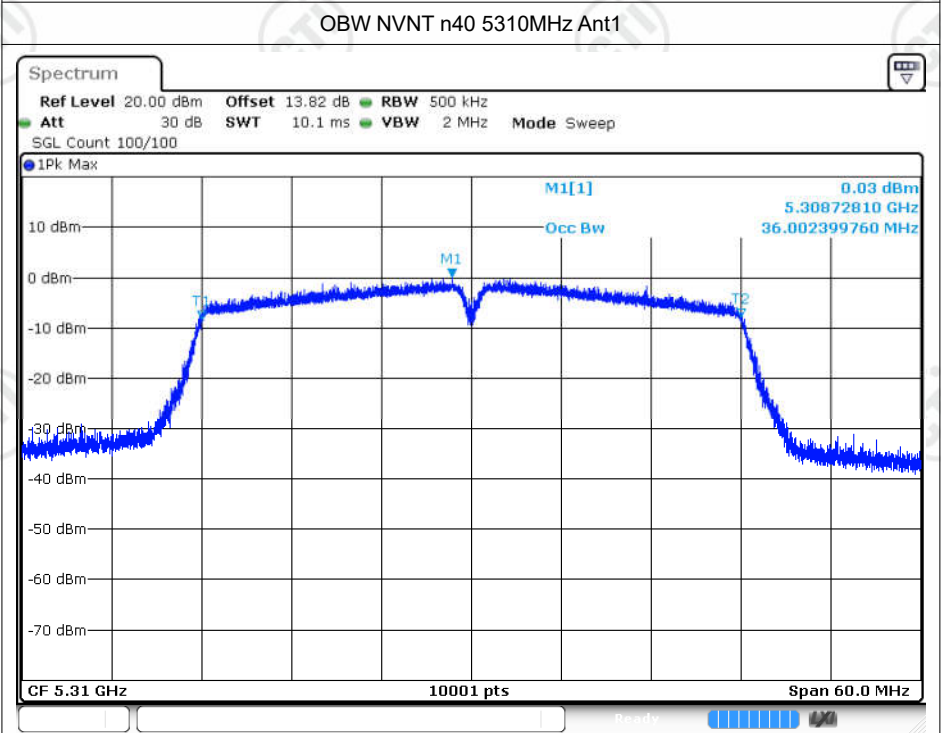


Date: 5.MAY.2024 13:20:12

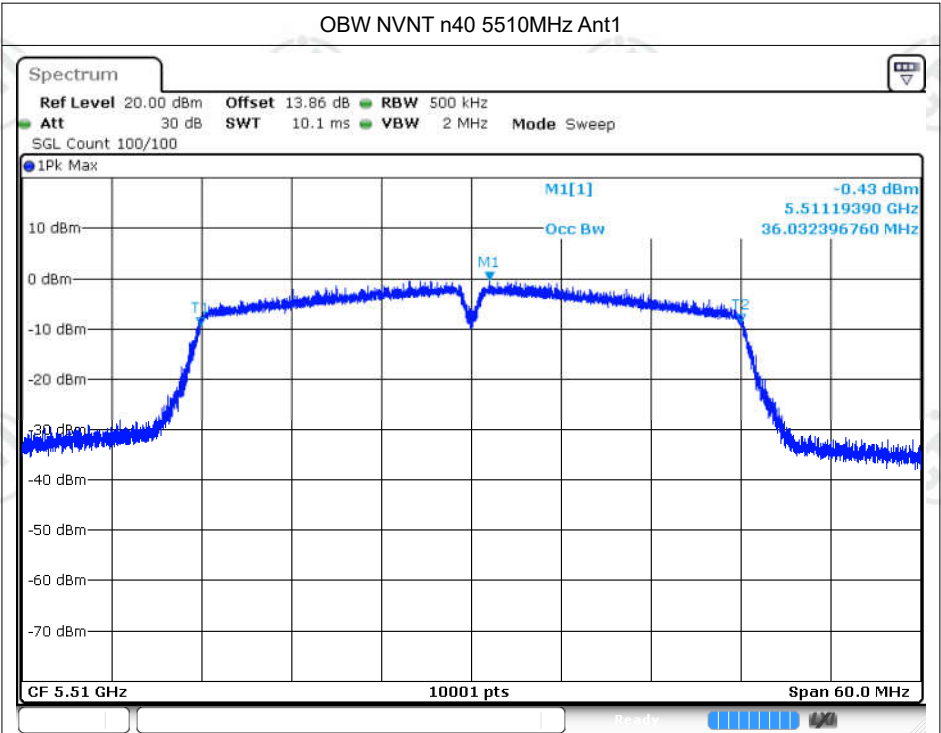


Date: 5.MAY.2024 13:22:07

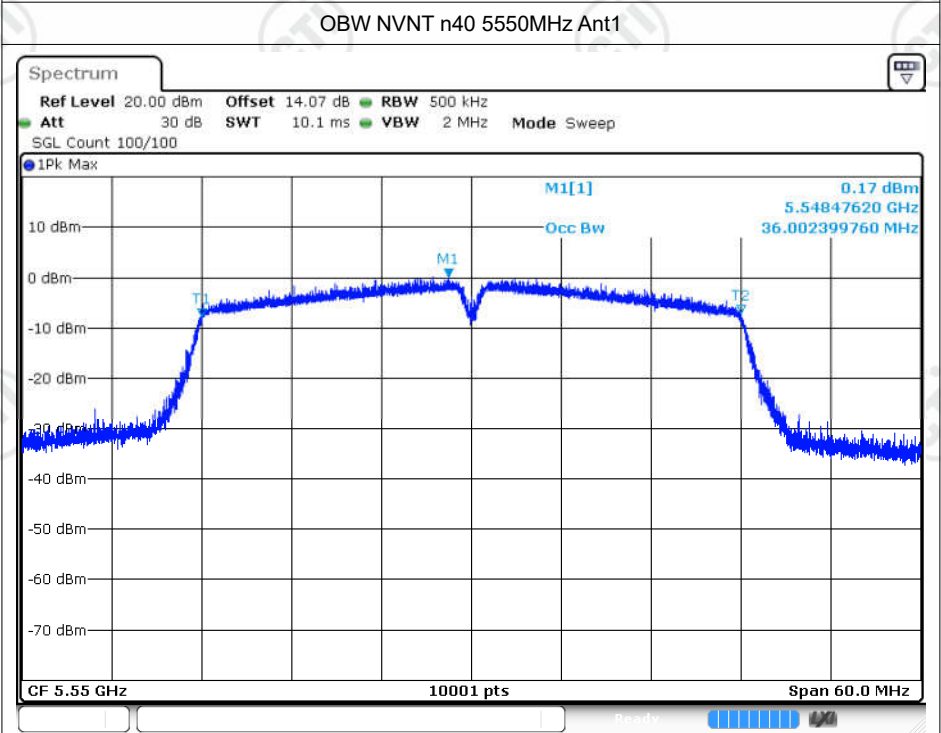


Date: 5.MAY.2024 13:27:46

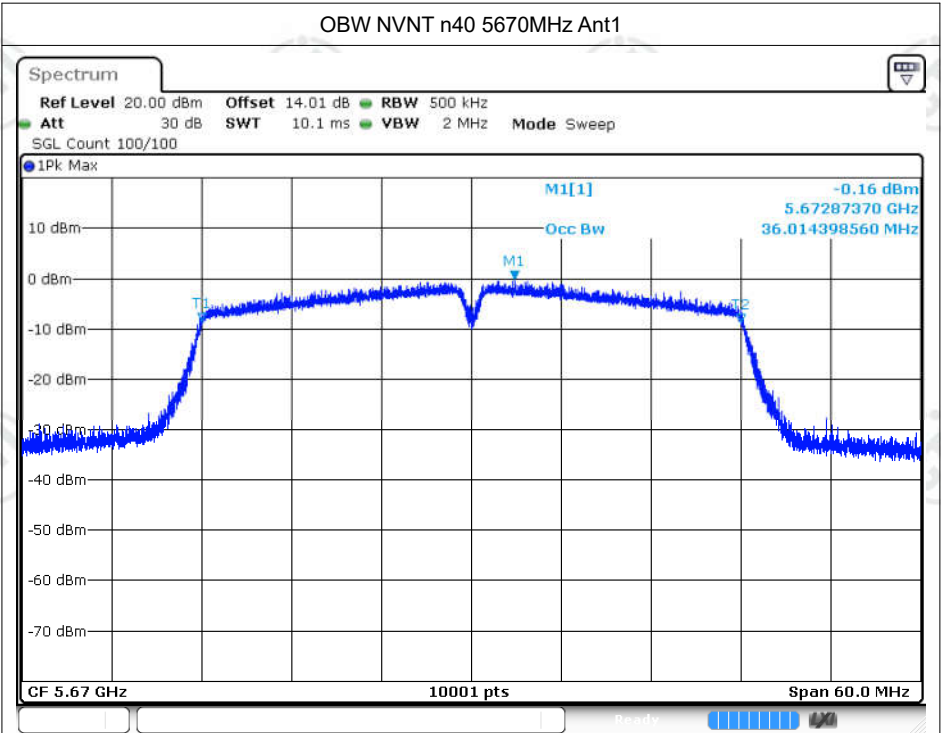


Date: 5.MAY.2024 13:29:40

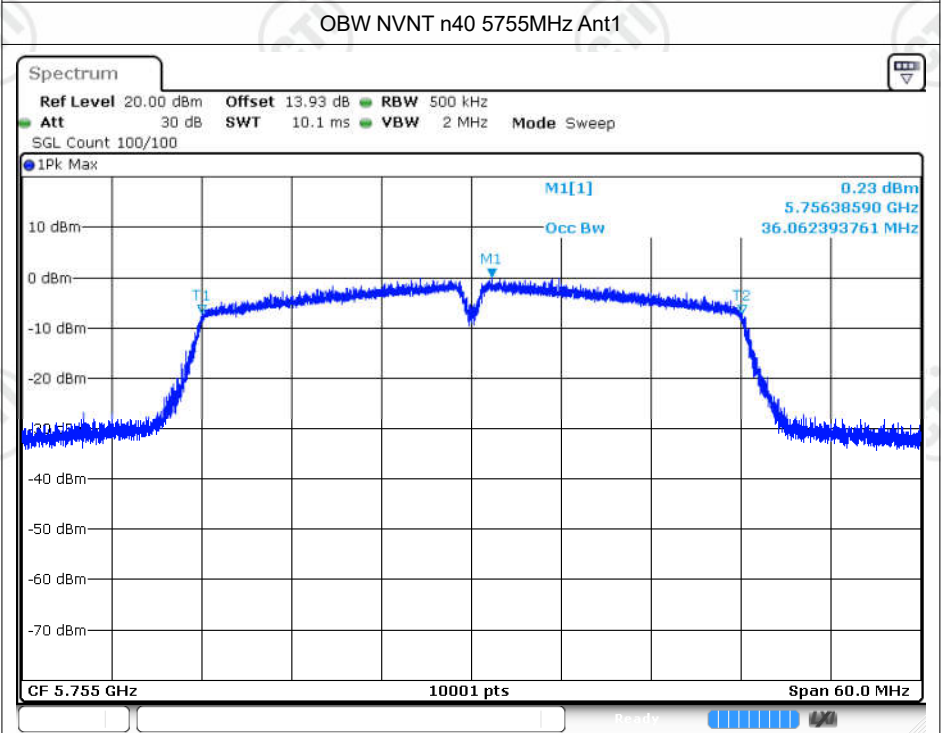



Date: 5.MAY.2024 13:14:47

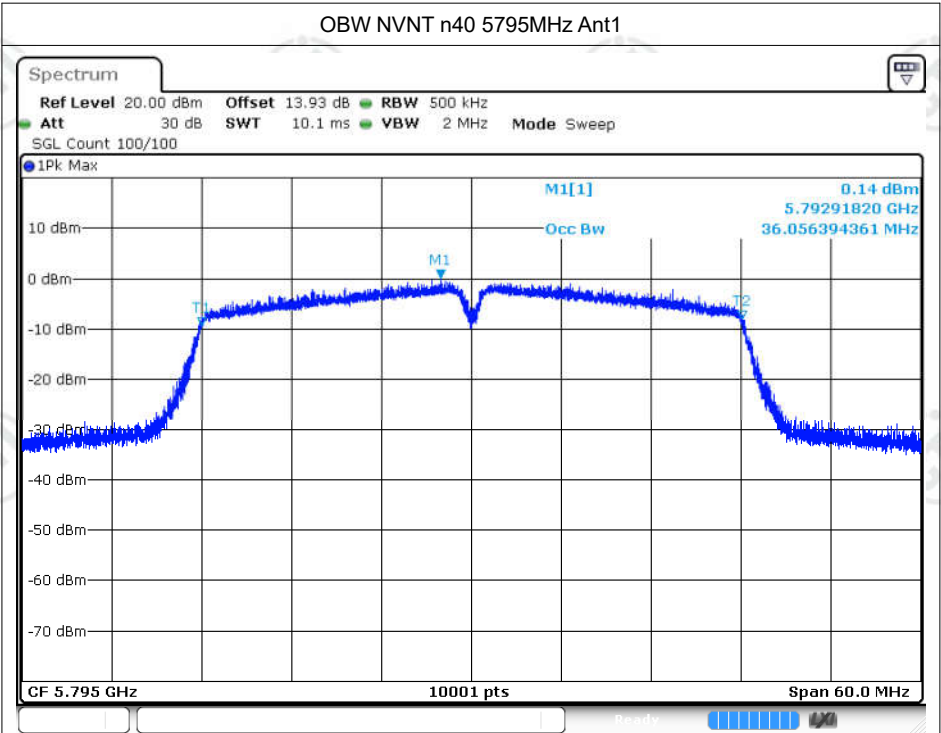


Date: 5.MAY.2024 13:16:43

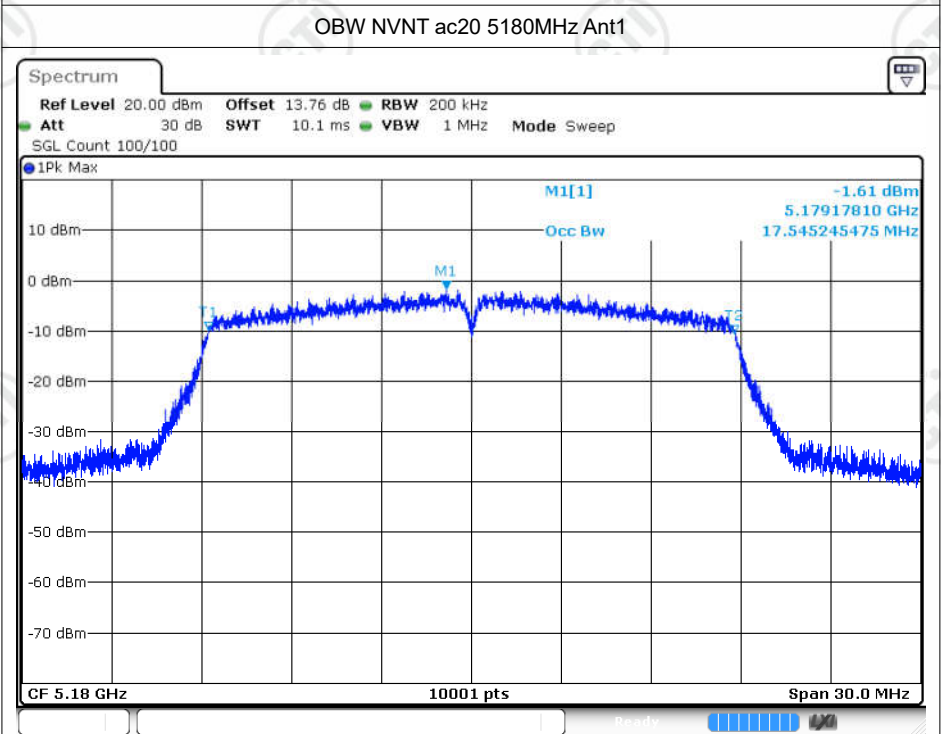


Date: 5.MAY.2024 13:31:53

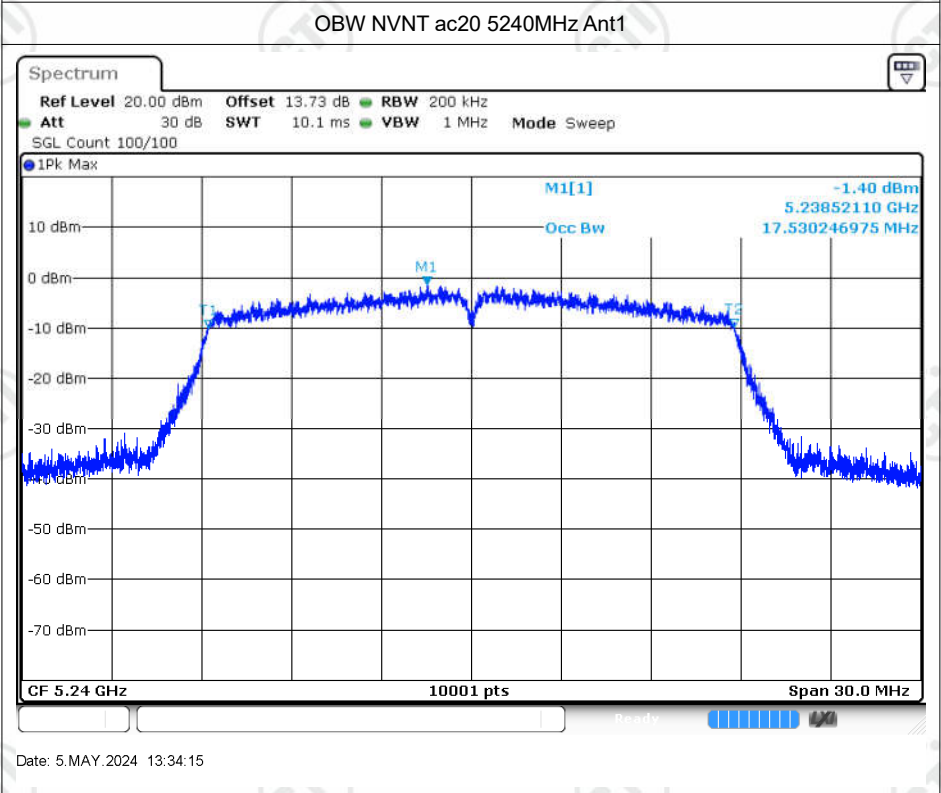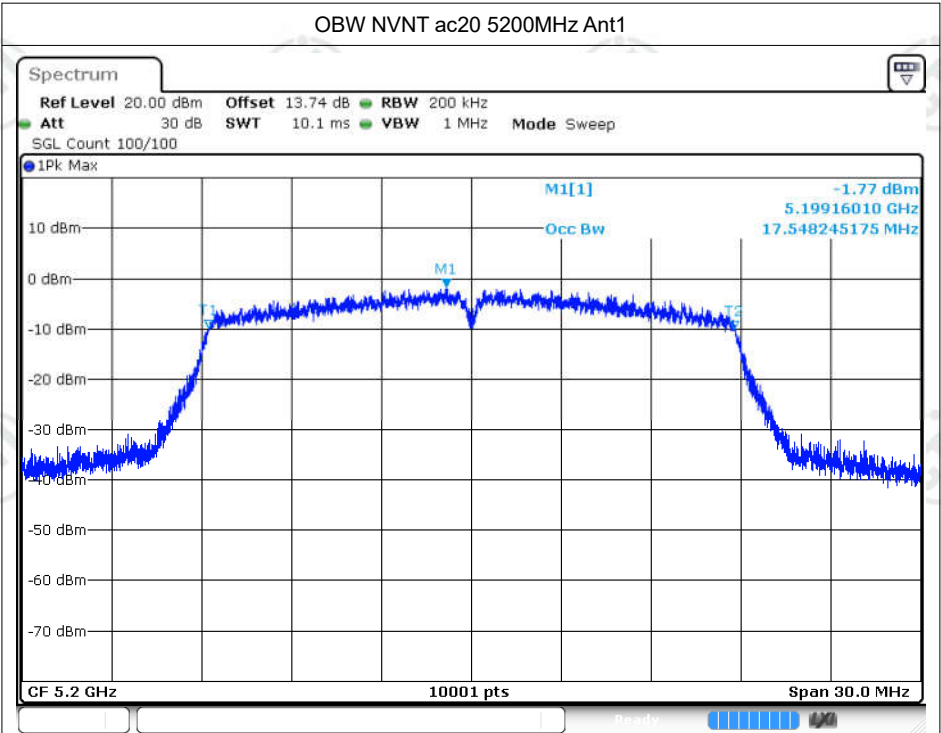


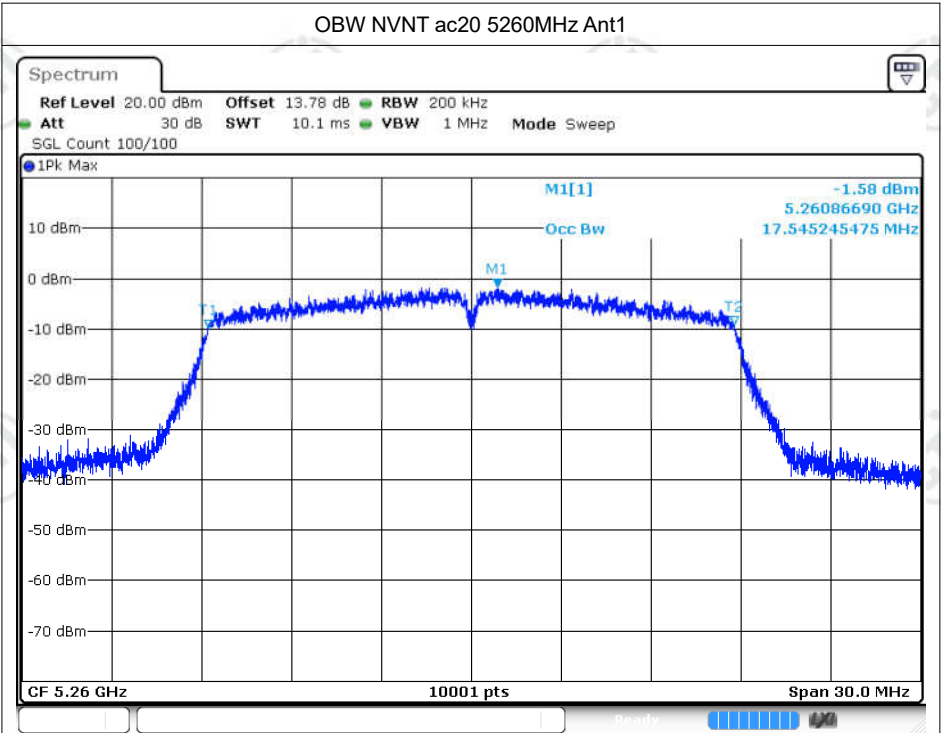


Date: 5.MAY.2024 13:39:40

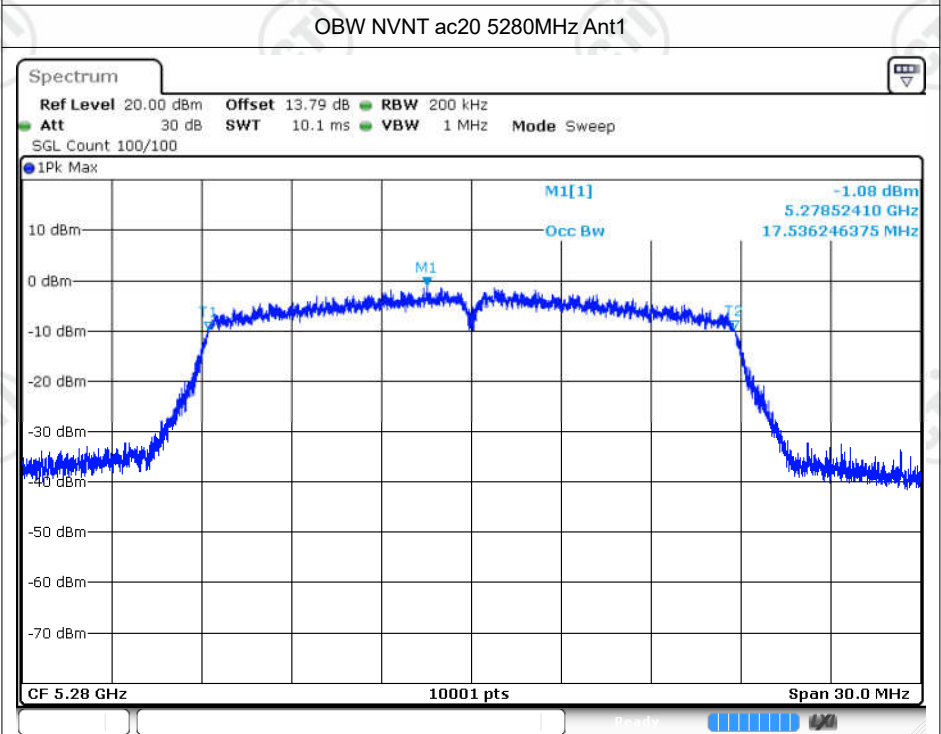


Date: 5.MAY.2024 13:42:02

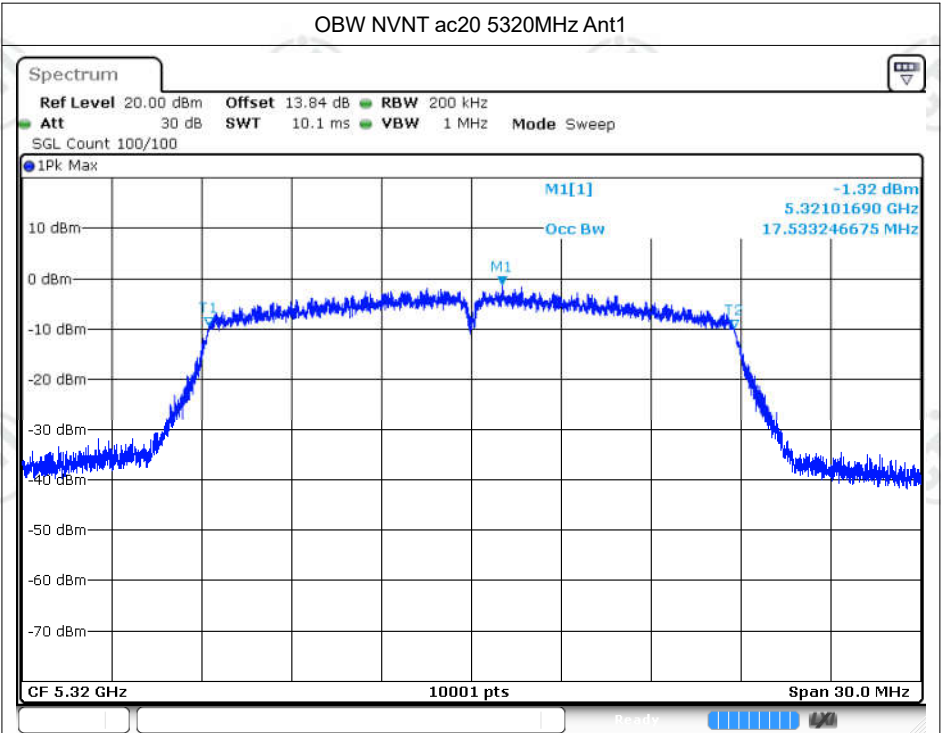


Date: 5.MAY.2024 13:43:46

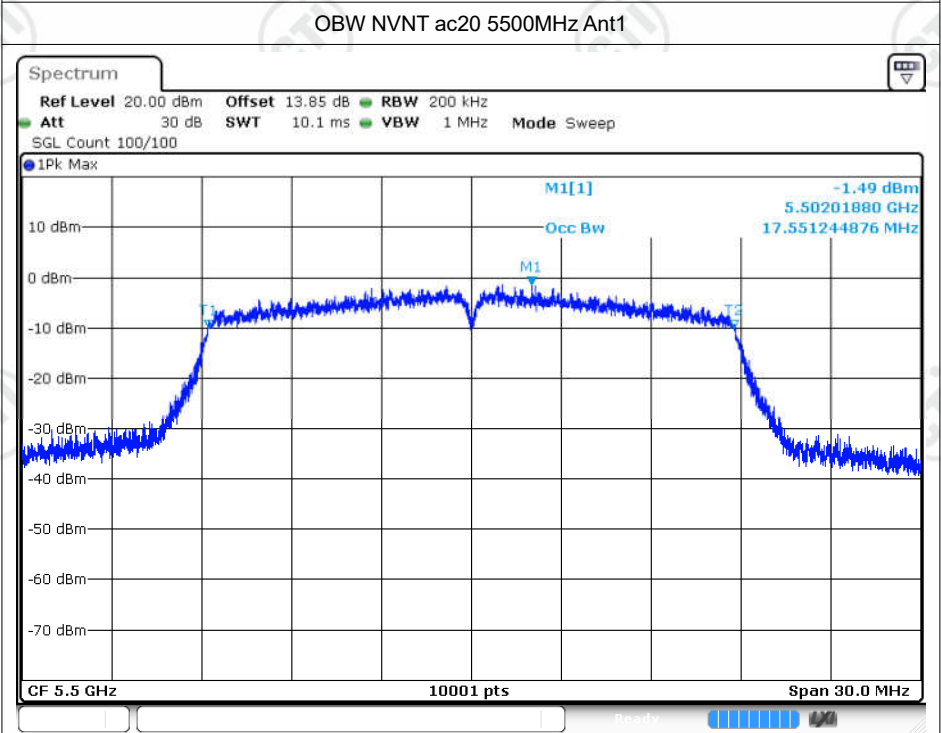



Date: 5.MAY.2024 13:45:17

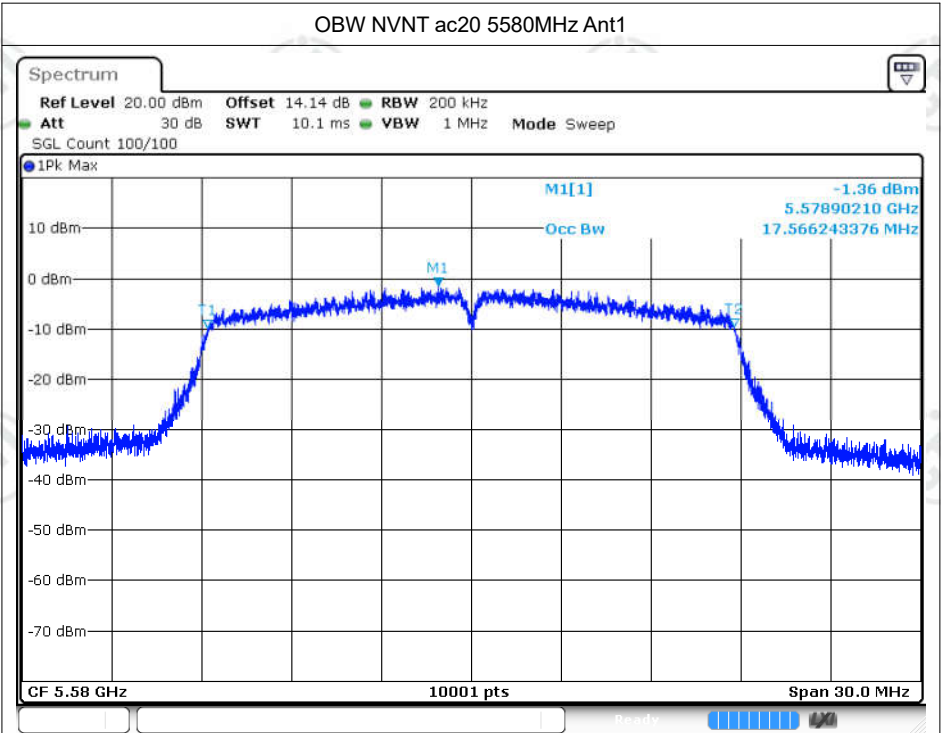


Date: 5.MAY.2024 13:48:21

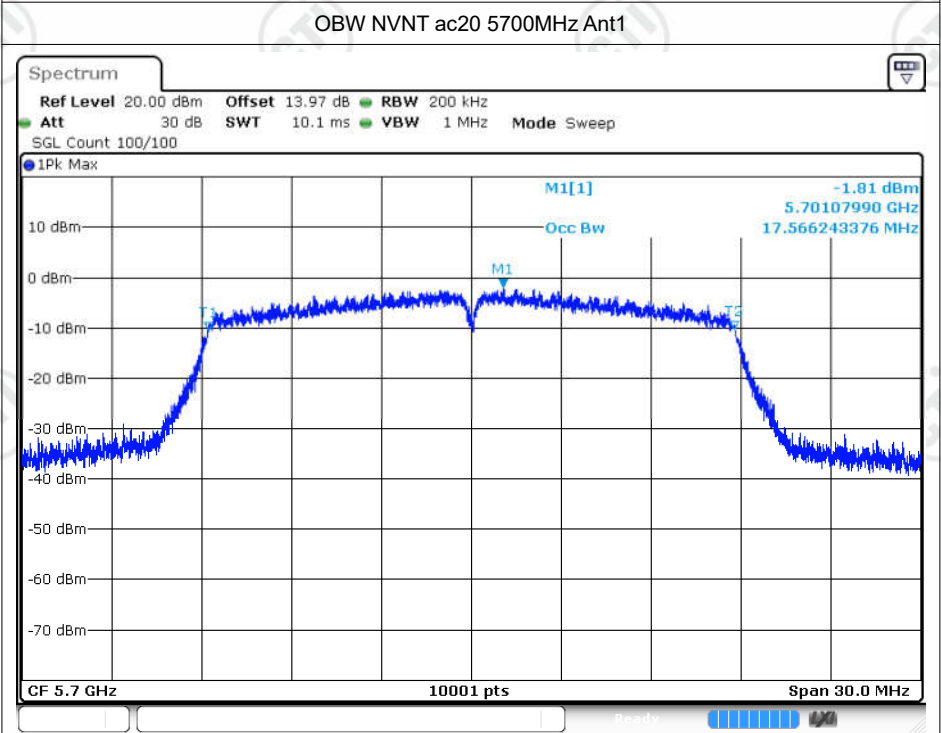


Date: 5.MAY.2024 13:46:53

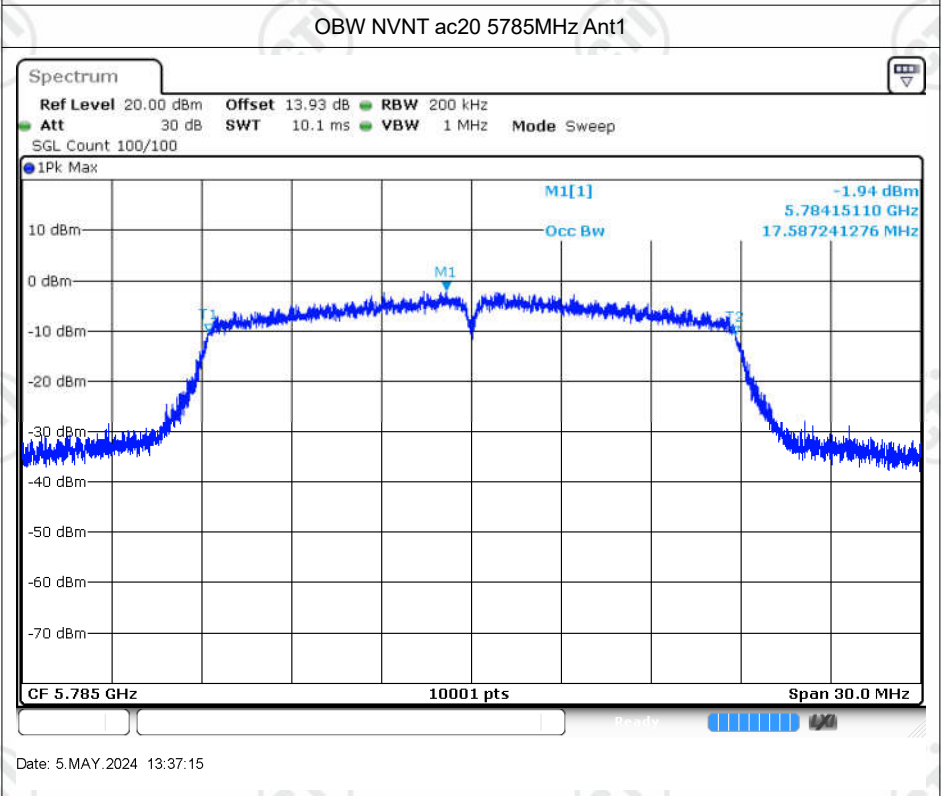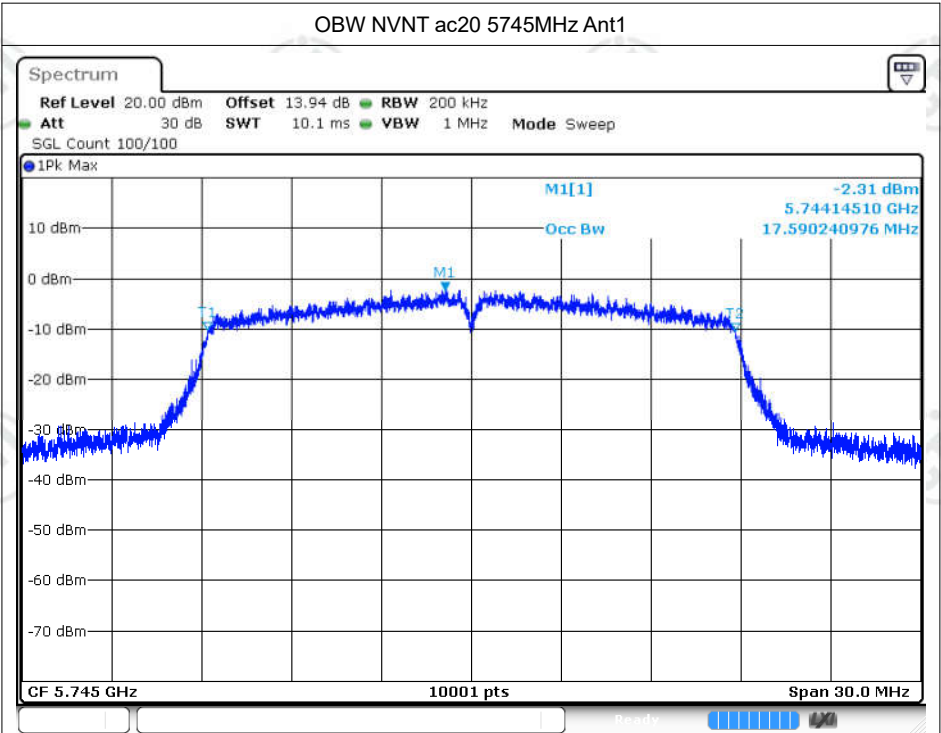


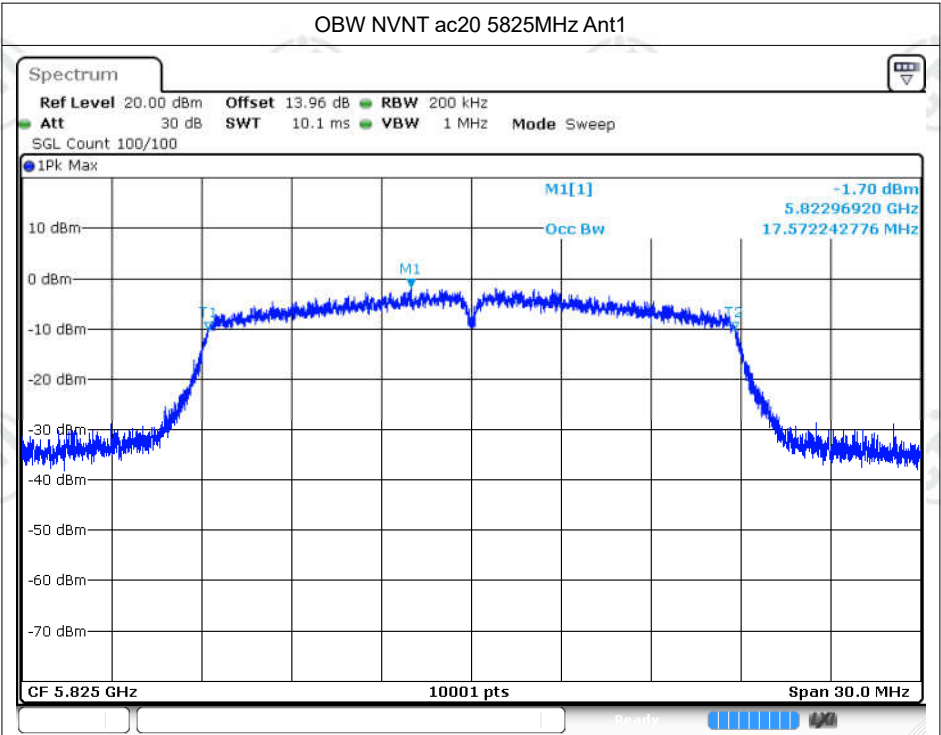


Date: 5.MAY.2024 13:38:06

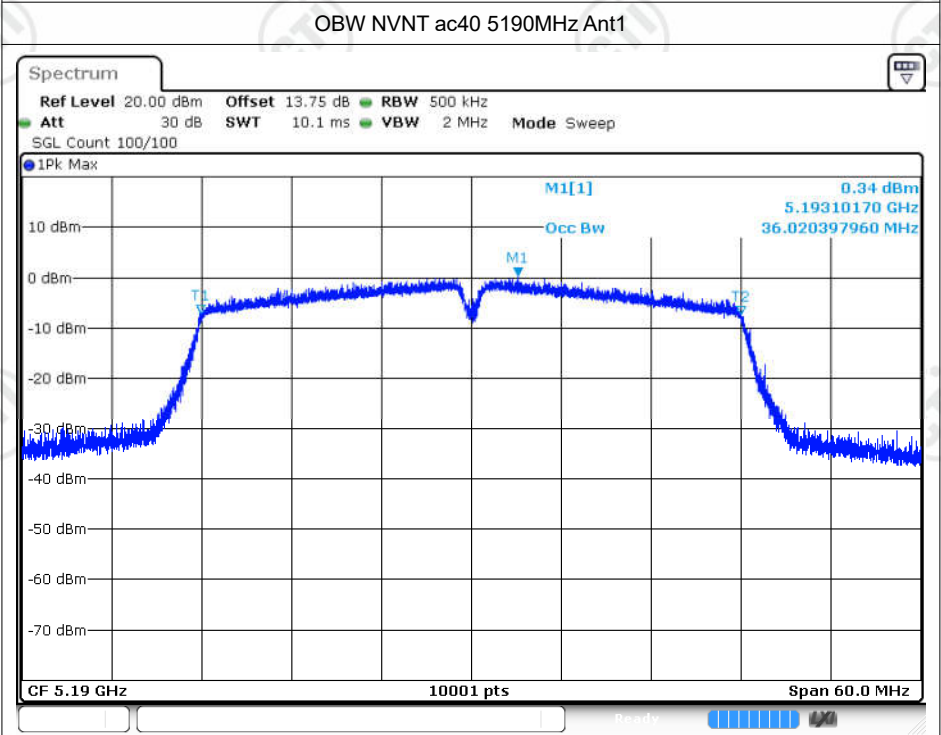



Date: 5.MAY.2024 13:50:30

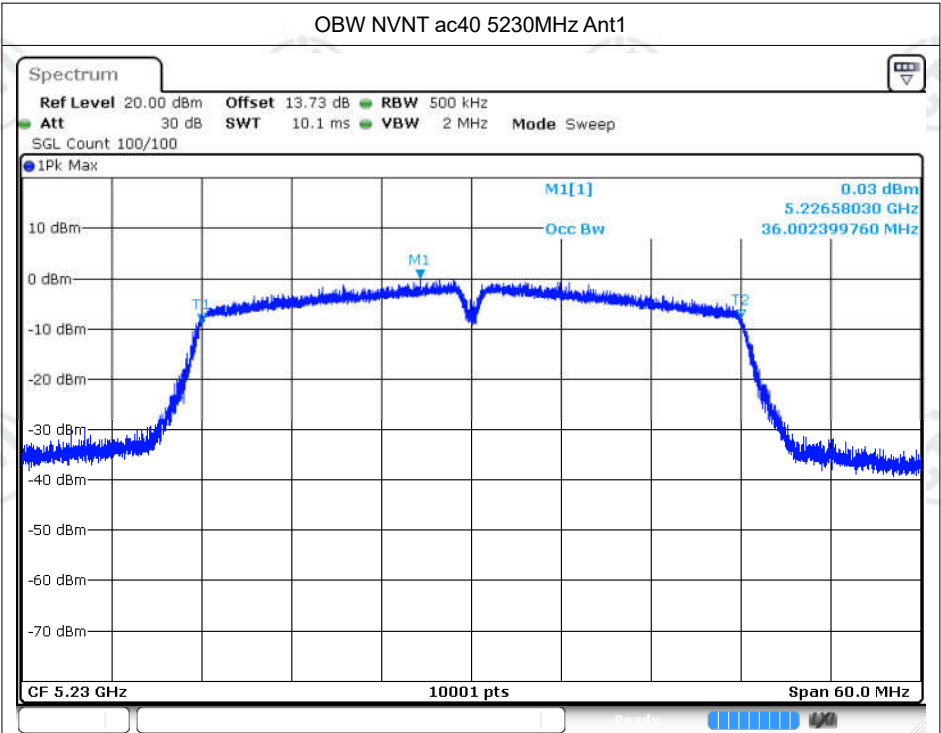


Date: 5.MAY.2024 13:52:18

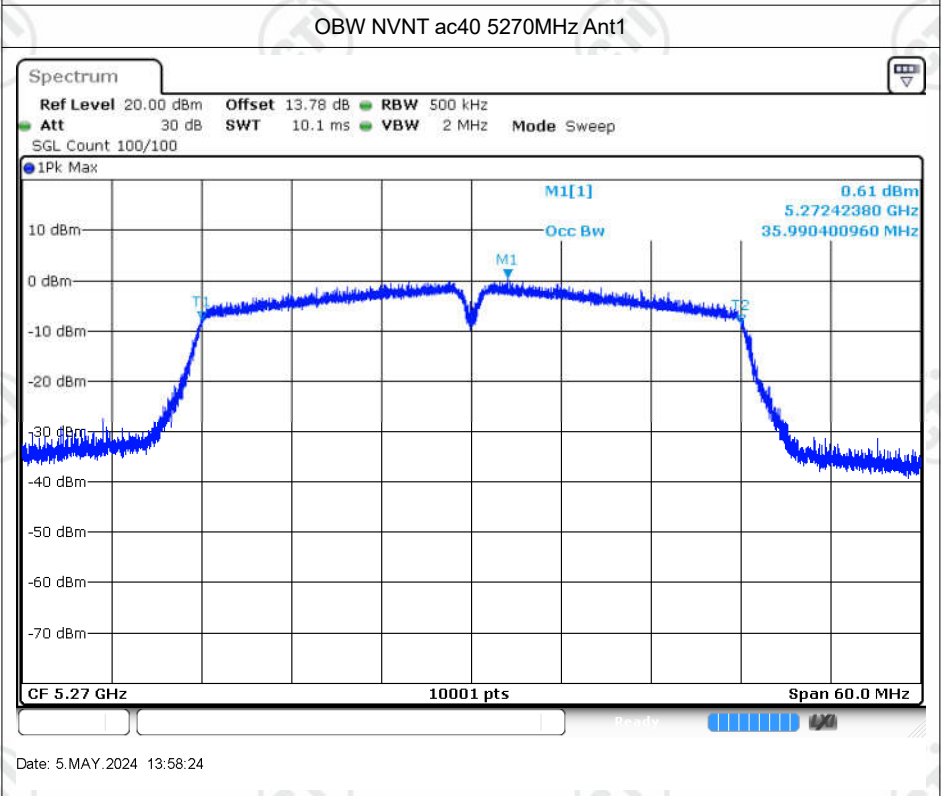


Date: 5.MAY.2024 13:58:24

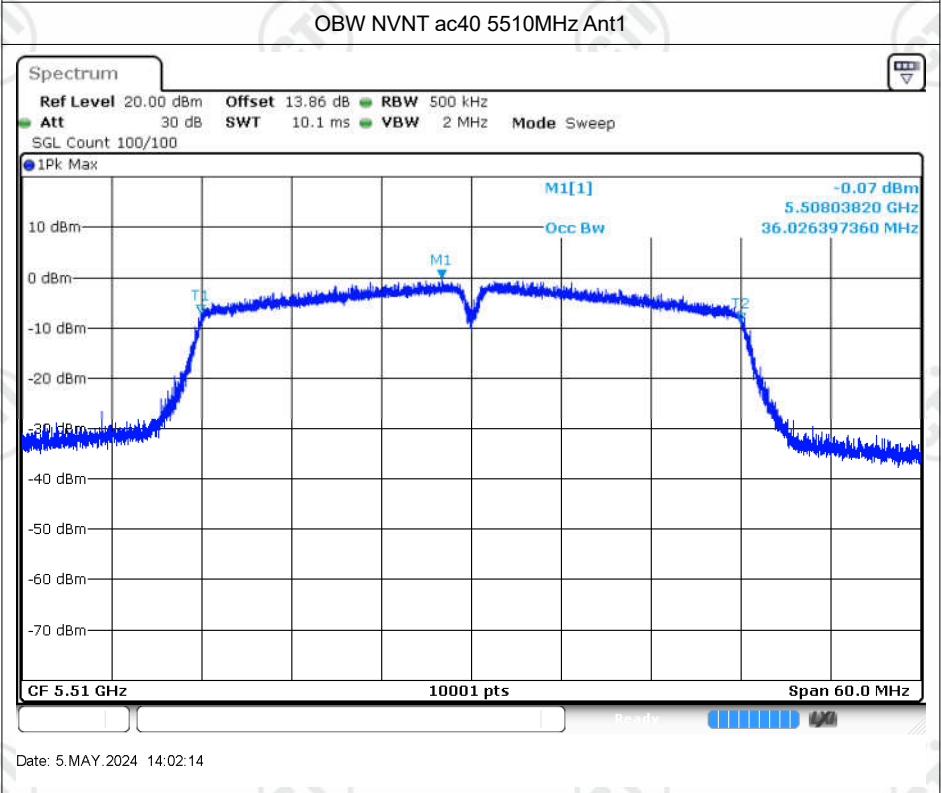
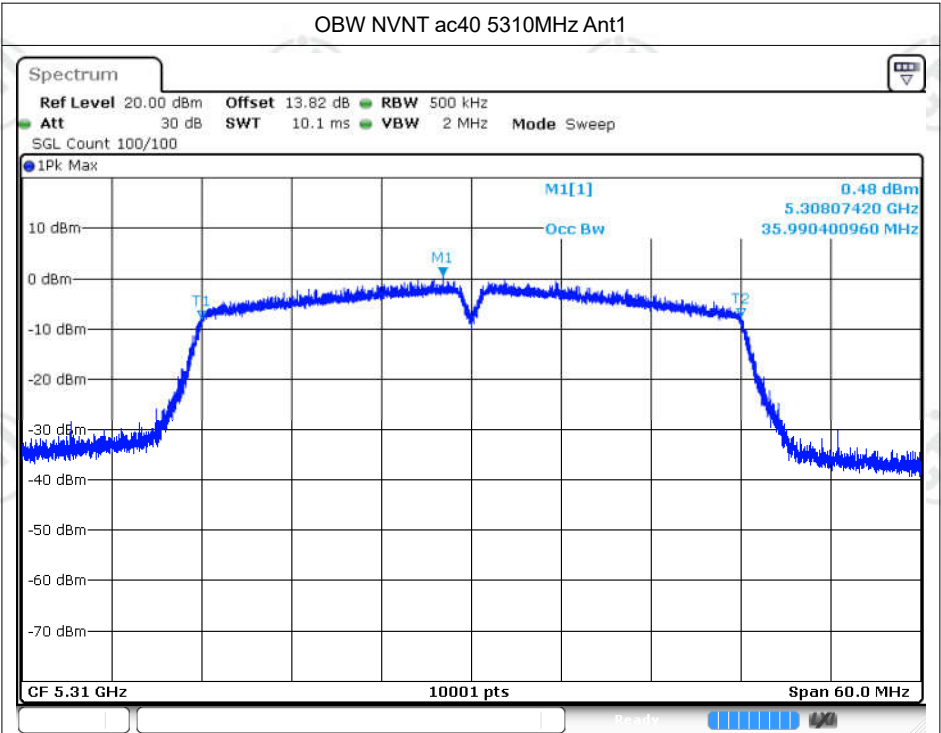


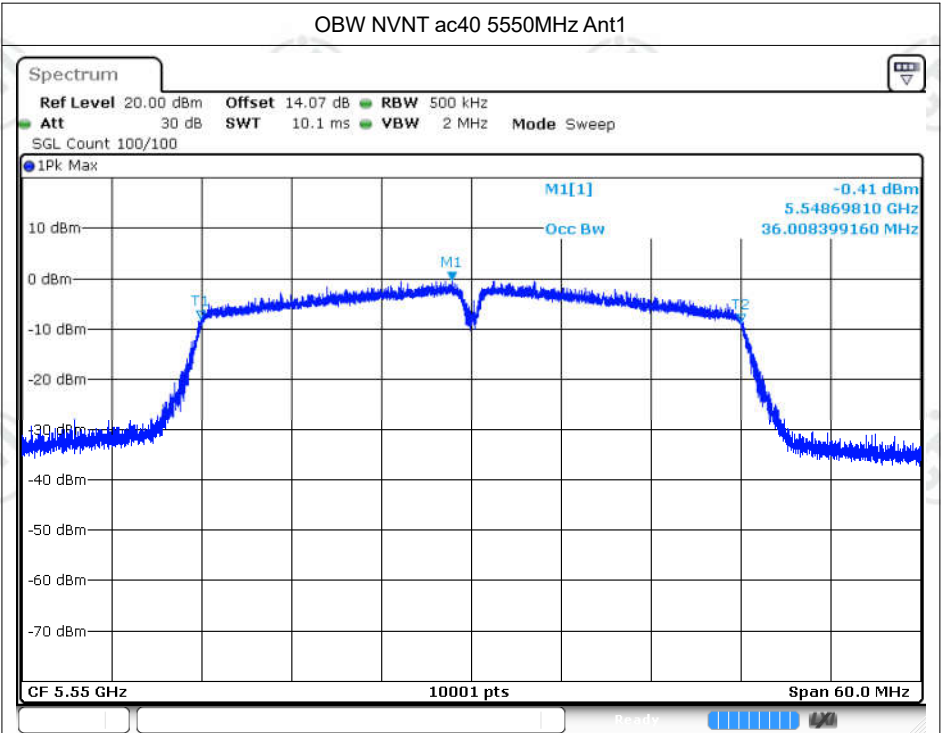


Date: 5.MAY.2024 14:04:07

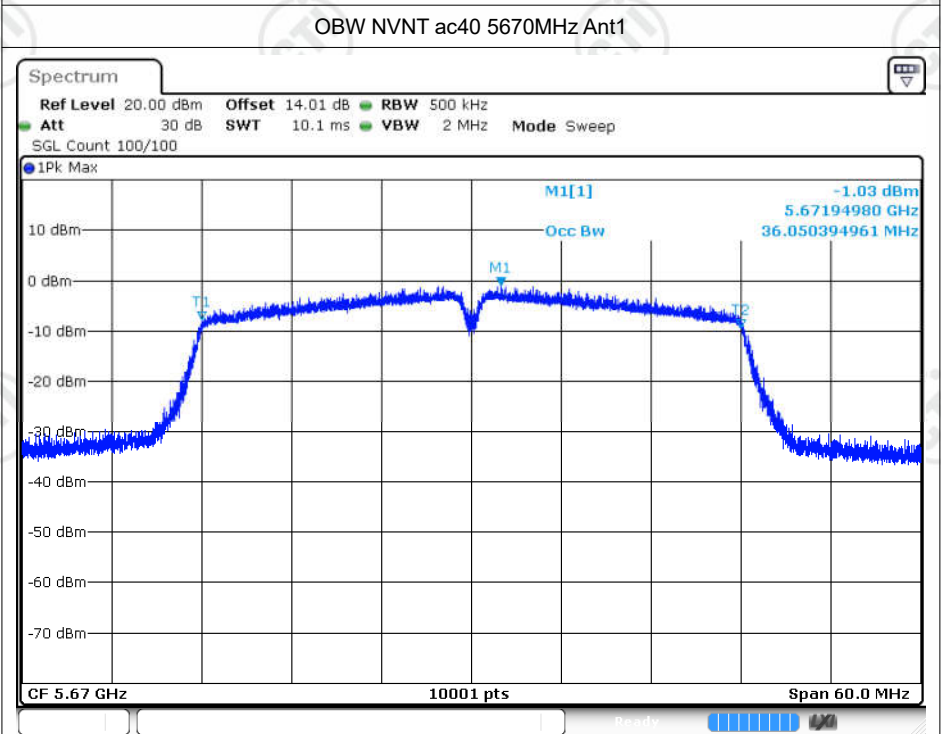


Date: 5.MAY.2024 14:05:50

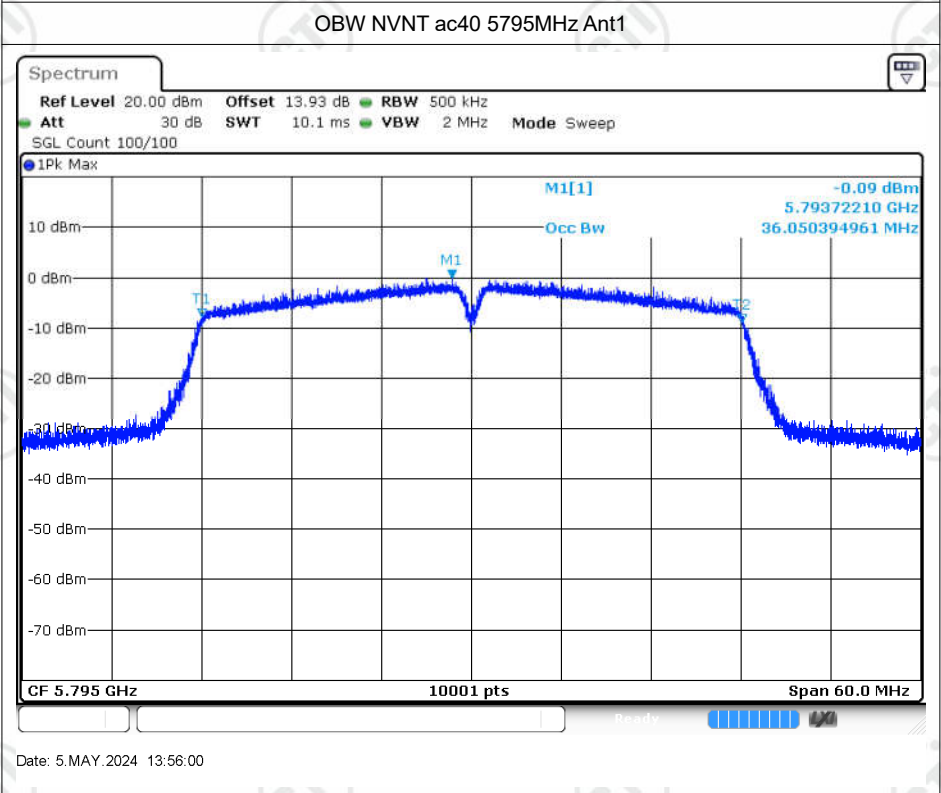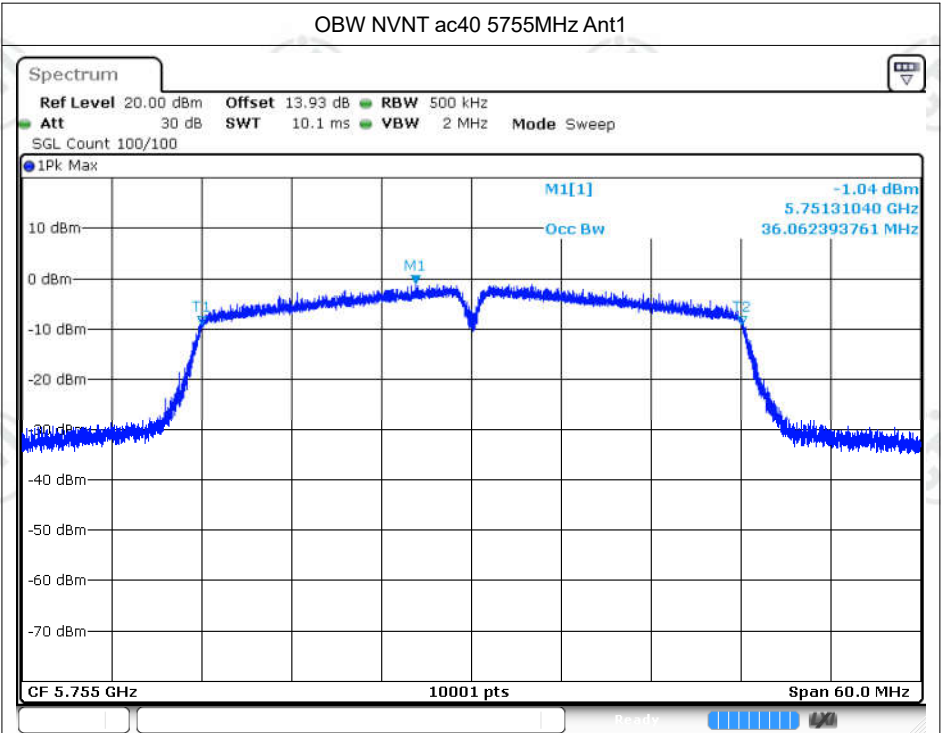


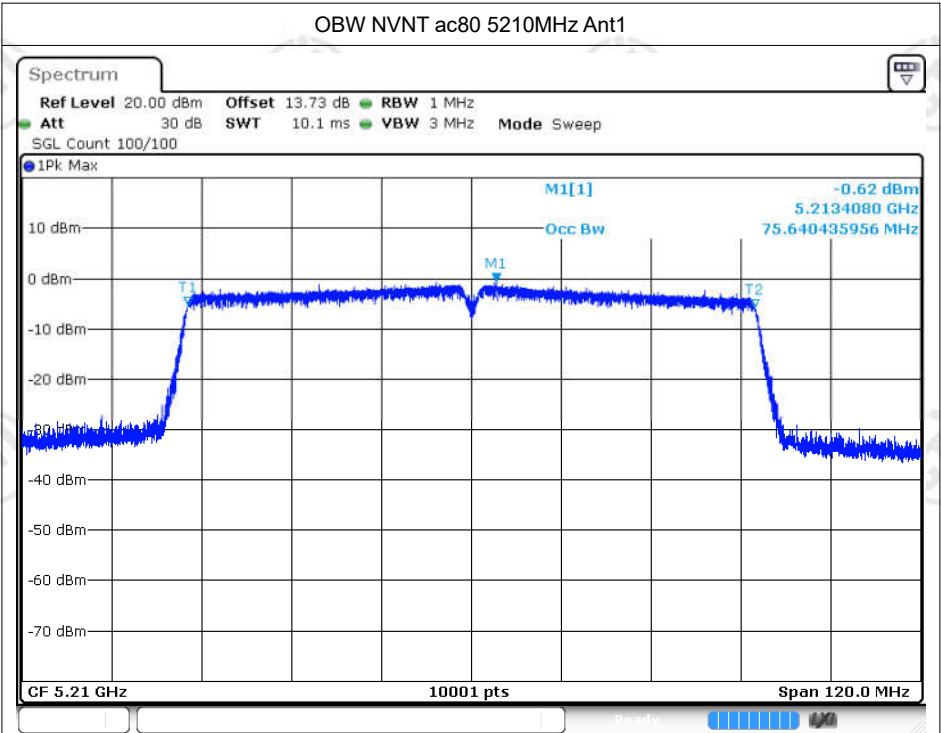


Date: 5.MAY.2024 14:09:33

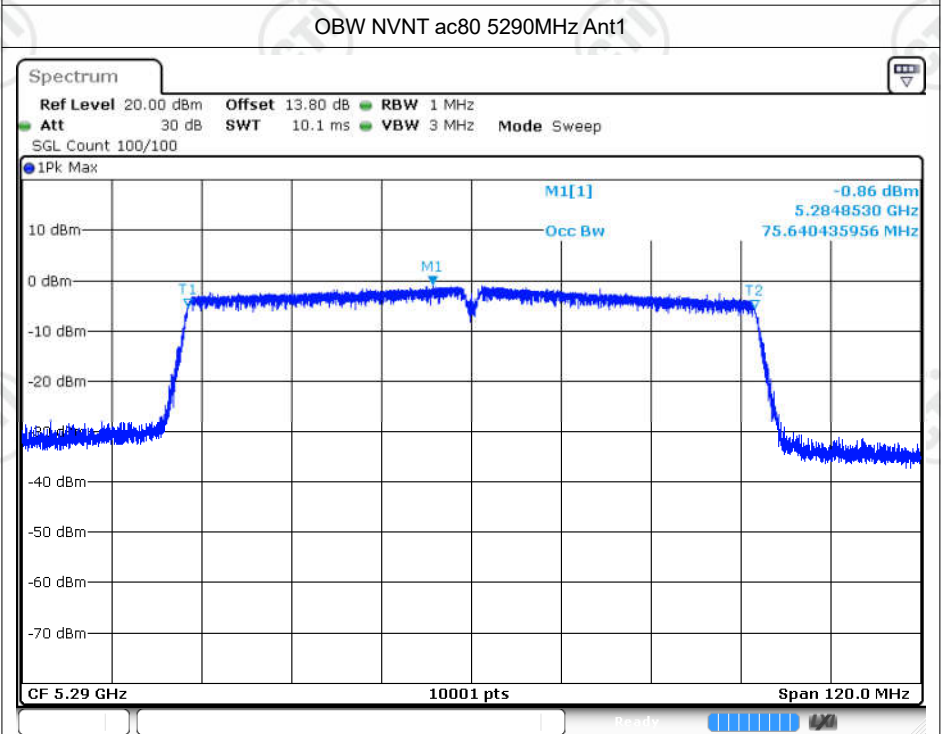

Date: 5.MAY.2024 14:14:42

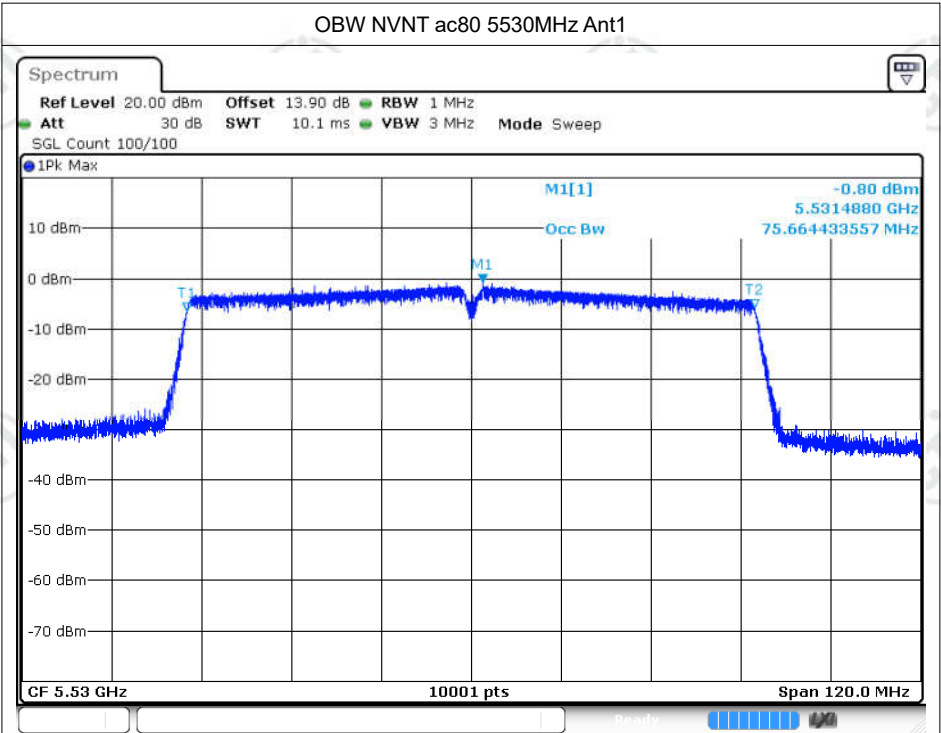

Date: 5.MAY.2024 14:17:09

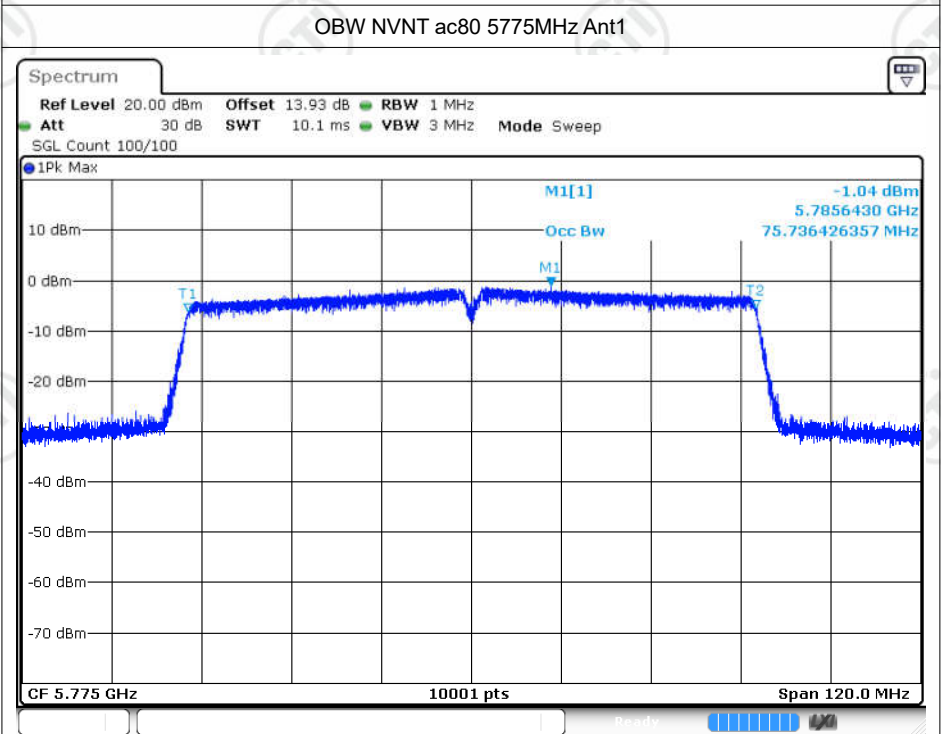


Date: 5.MAY.2024 14:12:02


## Maximum Power Spectral Density Level

| Condition | Mode | Frequency (MHz) | Antenna | Conducted PSD (dBm) | Limit (dBm) | Verdict |
|-----------|------|-----------------|---------|---------------------|-------------|---------|
| NVNT      | a    | 5180            | Ant1    | -2.13               | 10.4        | Pass    |
| NVNT      | a    | 5200            | Ant1    | -2.36               | 10.4        | Pass    |
| NVNT      | a    | 5240            | Ant1    | -2.53               | 10.4        | Pass    |
| NVNT      | a    | 5260            | Ant1    | -2.56               | 10.4        | Pass    |
| NVNT      | a    | 5280            | Ant1    | -2.69               | 10.4        | Pass    |
| NVNT      | a    | 5320            | Ant1    | -5.31               | 10.4        | Pass    |
| NVNT      | a    | 5500            | Ant1    | -2.91               | 10.4        | Pass    |
| NVNT      | a    | 5580            | Ant1    | -3.28               | 10.4        | Pass    |
| NVNT      | a    | 5700            | Ant1    | -3.59               | 10.4        | Pass    |
| NVNT      | a    | 5745            | Ant1    | -6.38               | 29.4        | Pass    |
| NVNT      | a    | 5785            | Ant1    | -5.98               | 29.4        | Pass    |
| NVNT      | a    | 5825            | Ant1    | -6.19               | 29.4        | Pass    |
| NVNT      | n20  | 5180            | Ant1    | -3.43               | 10.4        | Pass    |
| NVNT      | n20  | 5200            | Ant1    | -3.1                | 10.4        | Pass    |
| NVNT      | n20  | 5240            | Ant1    | -3.14               | 10.4        | Pass    |
| NVNT      | n20  | 5260            | Ant1    | -2.92               | 10.4        | Pass    |
| NVNT      | n20  | 5280            | Ant1    | -3.02               | 10.4        | Pass    |
| NVNT      | n20  | 5320            | Ant1    | -3.28               | 10.4        | Pass    |
| NVNT      | n20  | 5500            | Ant1    | -3.24               | 10.4        | Pass    |
| NVNT      | n20  | 5580            | Ant1    | -3.34               | 10.4        | Pass    |
| NVNT      | n20  | 5700            | Ant1    | -3.5                | 10.4        | Pass    |
| NVNT      | n20  | 5745            | Ant1    | -6.41               | 29.4        | Pass    |
| NVNT      | n20  | 5785            | Ant1    | -6.24               | 29.4        | Pass    |
| NVNT      | n20  | 5825            | Ant1    | -6.05               | 29.4        | Pass    |
| NVNT      | n40  | 5190            | Ant1    | -5.49               | 10.4        | Pass    |
| NVNT      | n40  | 5230            | Ant1    | -5.88               | 10.4        | Pass    |
| NVNT      | n40  | 5270            | Ant1    | -5.38               | 10.4        | Pass    |
| NVNT      | n40  | 5310            | Ant1    | -5.88               | 10.4        | Pass    |
| NVNT      | n40  | 5510            | Ant1    | -6.09               | 10.4        | Pass    |
| NVNT      | n40  | 5550            | Ant1    | -5.58               | 10.4        | Pass    |
| NVNT      | n40  | 5670            | Ant1    | -5.96               | 10.4        | Pass    |
| NVNT      | n40  | 5755            | Ant1    | -8.7                | 29.4        | Pass    |
| NVNT      | n40  | 5795            | Ant1    | -8.88               | 29.4        | Pass    |
| NVNT      | ac20 | 5180            | Ant1    | -3.5                | 10.4        | Pass    |
| NVNT      | ac20 | 5200            | Ant1    | -3.24               | 10.4        | Pass    |
| NVNT      | ac20 | 5240            | Ant1    | -3.04               | 10.4        | Pass    |
| NVNT      | ac20 | 5260            | Ant1    | -3.02               | 10.4        | Pass    |
| NVNT      | ac20 | 5280            | Ant1    | -2.86               | 10.4        | Pass    |


|      |      |      |      |        |      |      |
|------|------|------|------|--------|------|------|
| NVNT | ac20 | 5320 | Ant1 | -3.1   | 10.4 | Pass |
| NVNT | ac20 | 5500 | Ant1 | -3.08  | 10.4 | Pass |
| NVNT | ac20 | 5580 | Ant1 | -3.13  | 10.4 | Pass |
| NVNT | ac20 | 5700 | Ant1 | -3.36  | 10.4 | Pass |
| NVNT | ac20 | 5745 | Ant1 | -6.57  | 29.4 | Pass |
| NVNT | ac20 | 5785 | Ant1 | -6.48  | 29.4 | Pass |
| NVNT | ac20 | 5825 | Ant1 | -6.05  | 29.4 | Pass |
| NVNT | ac40 | 5190 | Ant1 | -5.68  | 10.4 | Pass |
| NVNT | ac40 | 5230 | Ant1 | -5.96  | 10.4 | Pass |
| NVNT | ac40 | 5270 | Ant1 | -5.64  | 10.4 | Pass |
| NVNT | ac40 | 5310 | Ant1 | -6     | 10.4 | Pass |
| NVNT | ac40 | 5510 | Ant1 | -5.87  | 10.4 | Pass |
| NVNT | ac40 | 5550 | Ant1 | -6.07  | 10.4 | Pass |
| NVNT | ac40 | 5670 | Ant1 | -6.85  | 10.4 | Pass |
| NVNT | ac40 | 5755 | Ant1 | -9.47  | 29.4 | Pass |
| NVNT | ac40 | 5795 | Ant1 | -8.93  | 29.4 | Pass |
| NVNT | ac80 | 5210 | Ant1 | -10.06 | 10.4 | Pass |
| NVNT | ac80 | 5290 | Ant1 | -10.29 | 10.4 | Pass |
| NVNT | ac80 | 5530 | Ant1 | -10.58 | 10.4 | Pass |
| NVNT | ac80 | 5775 | Ant1 | -13.38 | 29.4 | Pass |

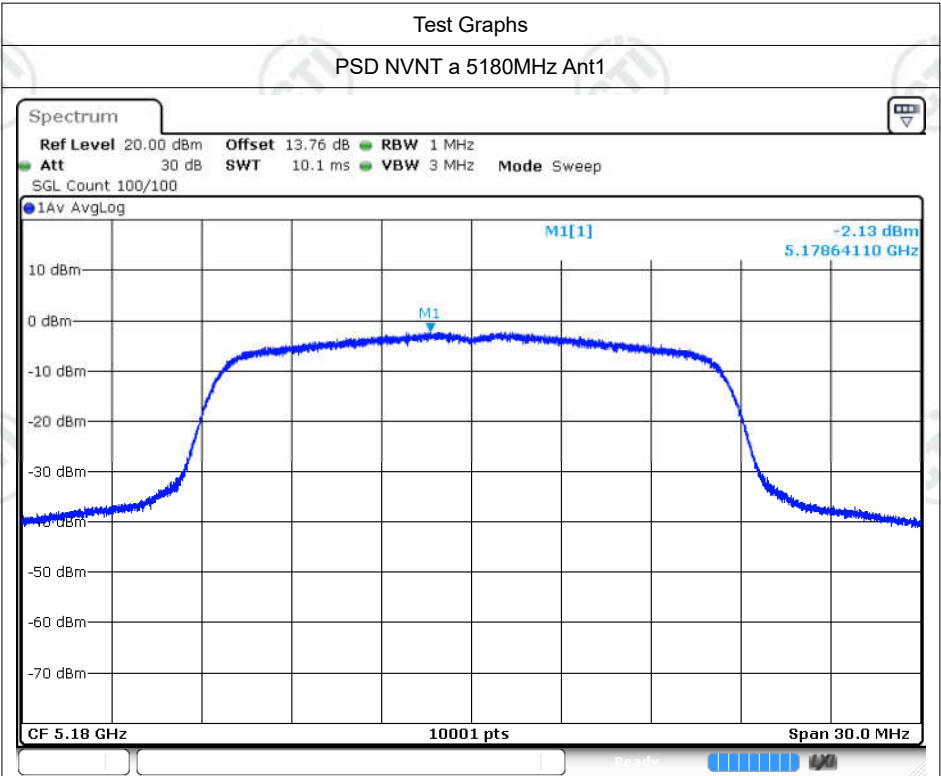


Date: 5.MAY.2024 12:27:09

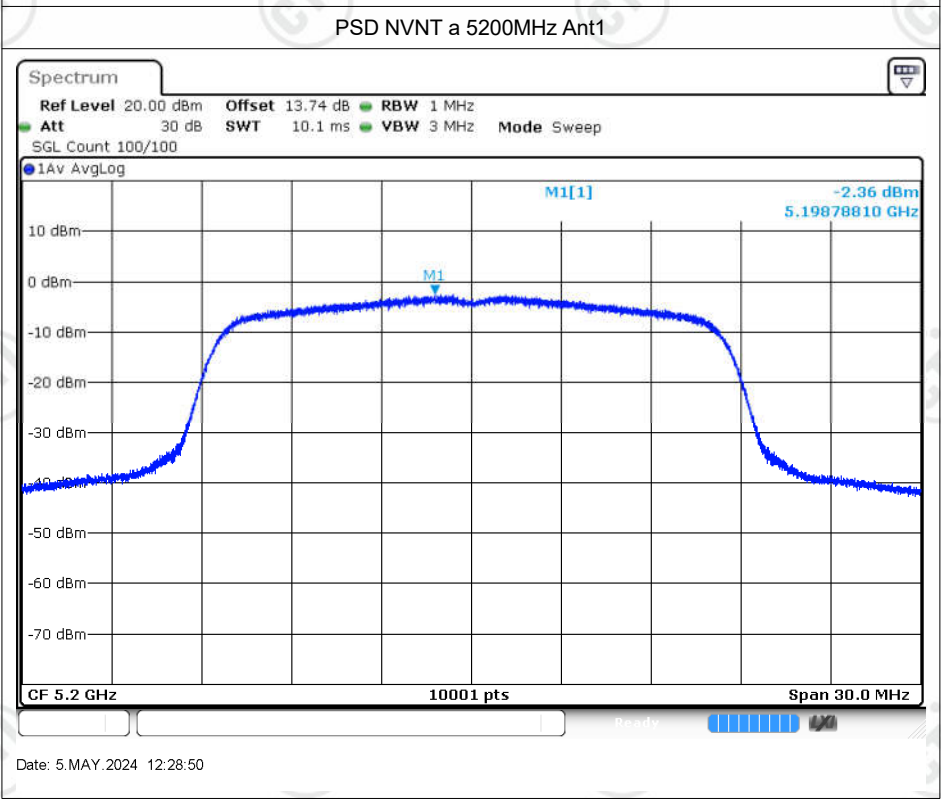


Date: 5.MAY.2024 12:28:50

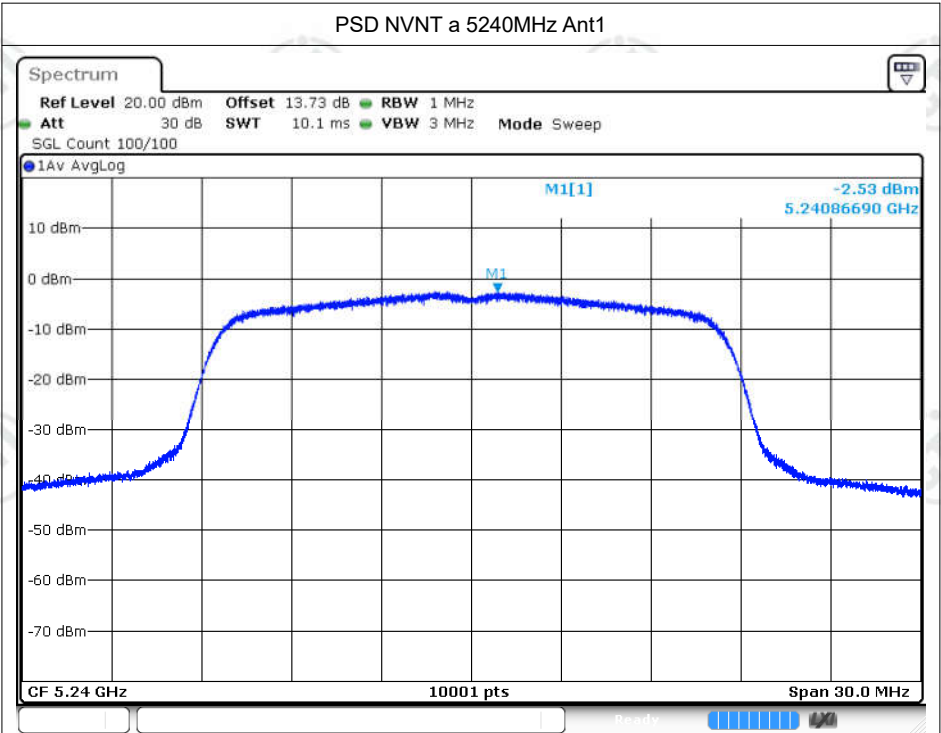


Date: 5.MAY.2024 12:29:59

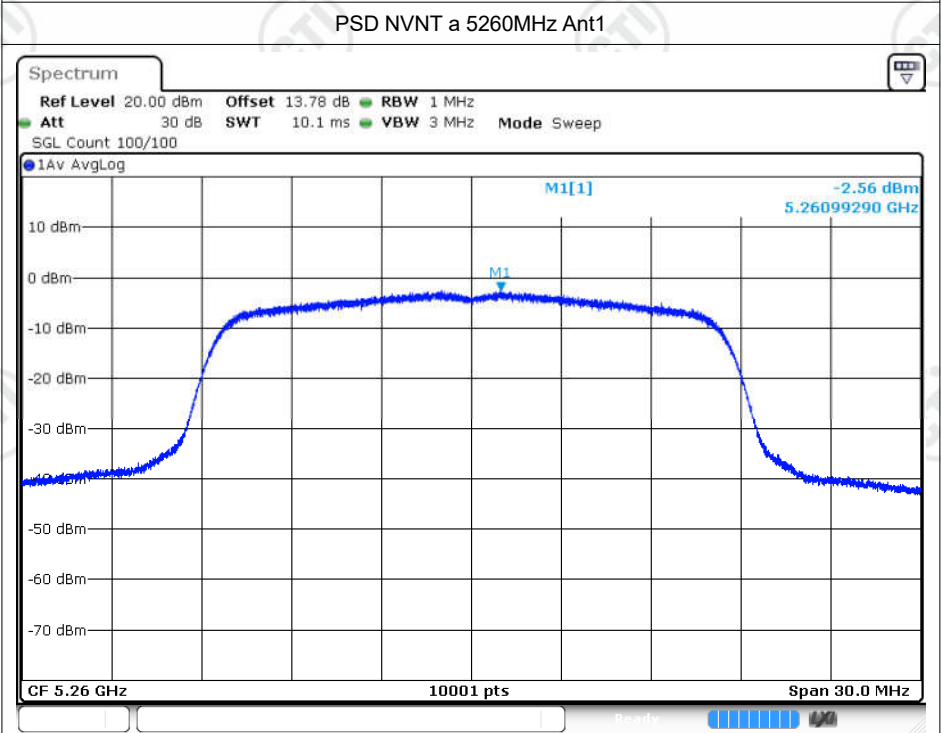


Date: 5.MAY.2024 12:37:06

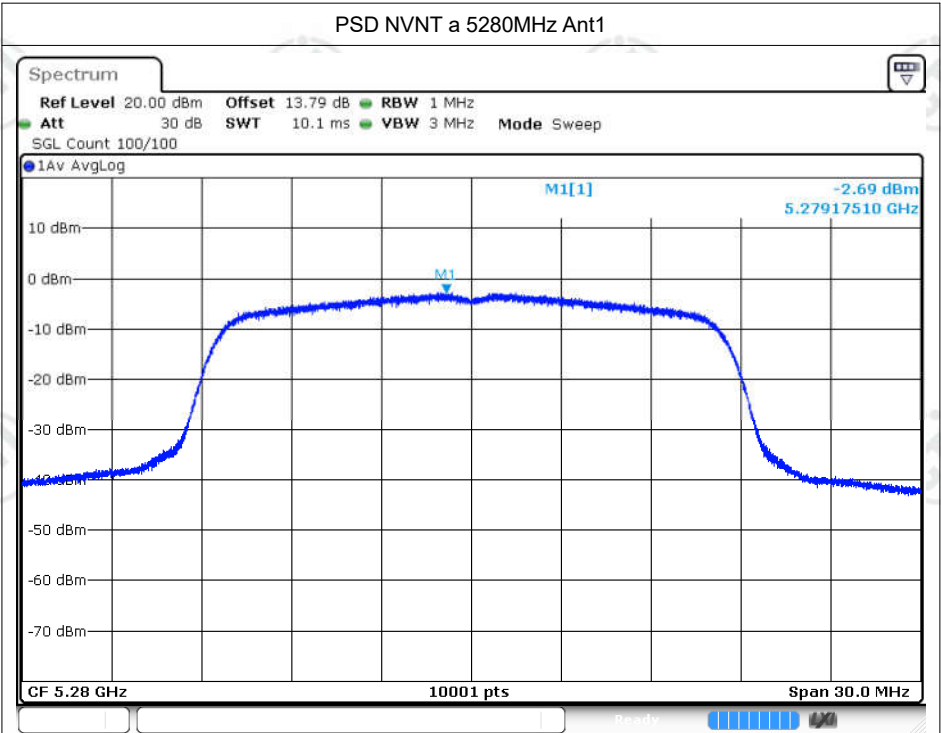


Date: 5.MAY.2024 12:39:43

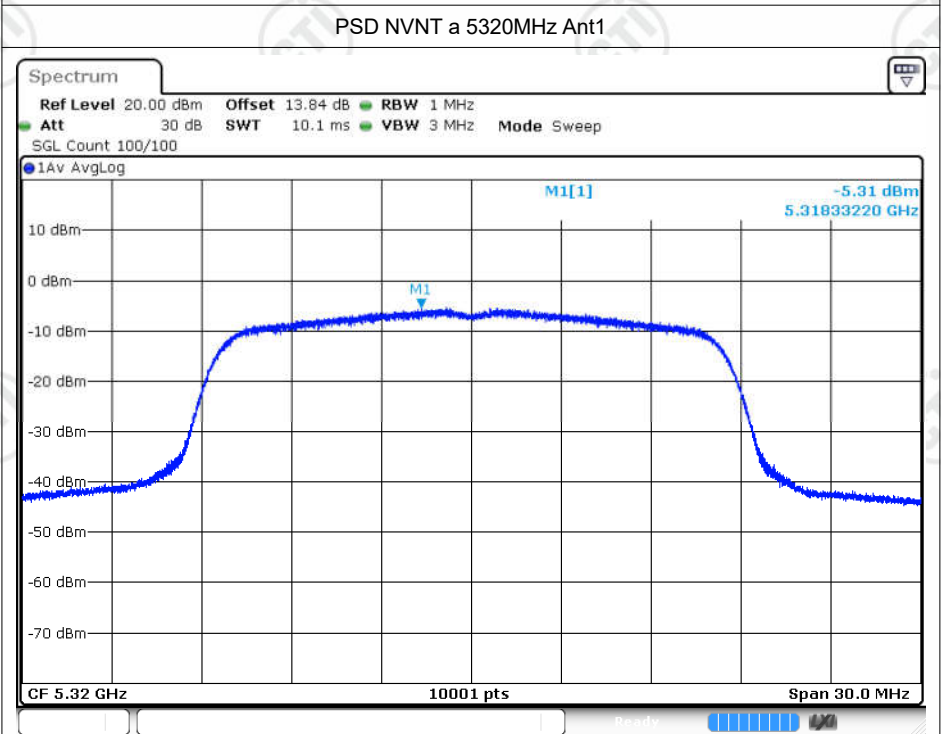


Date: 5.MAY.2024 12:41:24

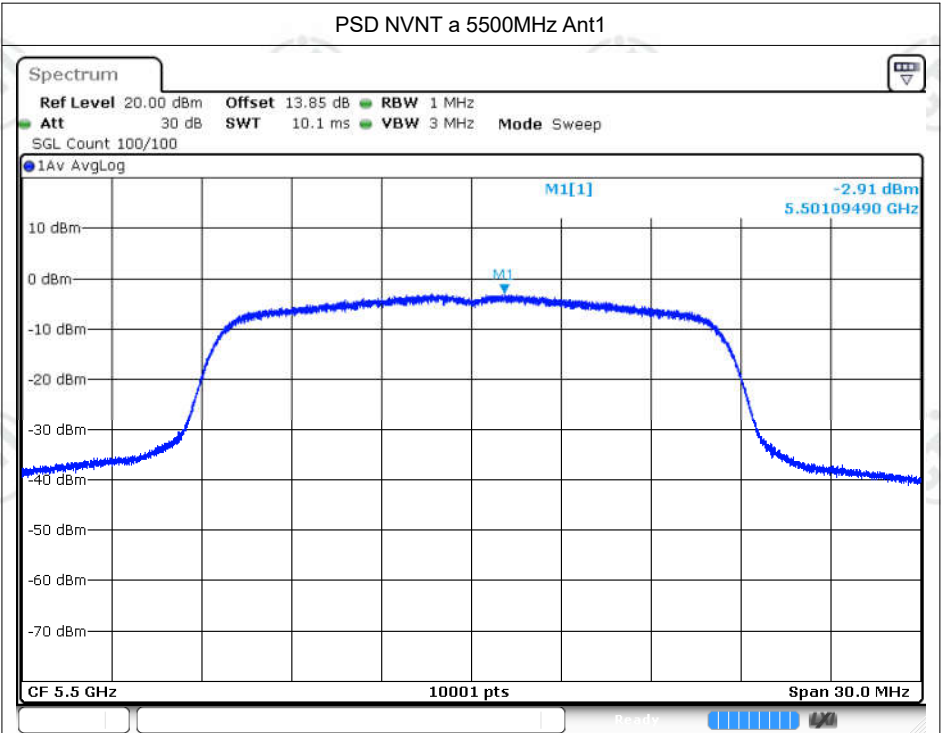


Date: 5.MAY.2024 12:43:49

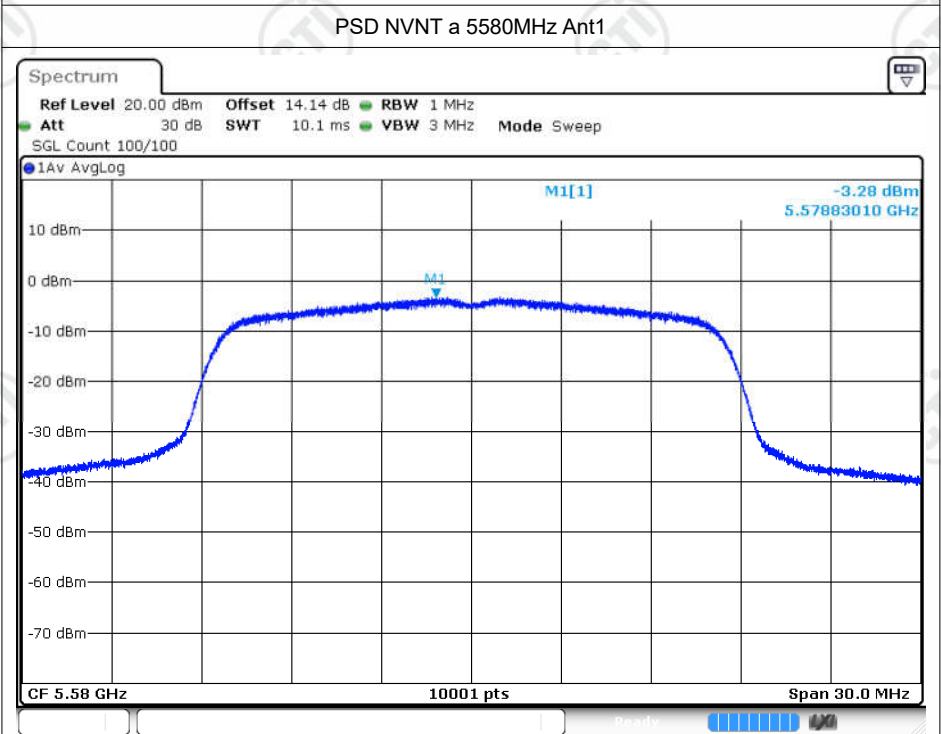


Date: 5.MAY.2024 12:47:37

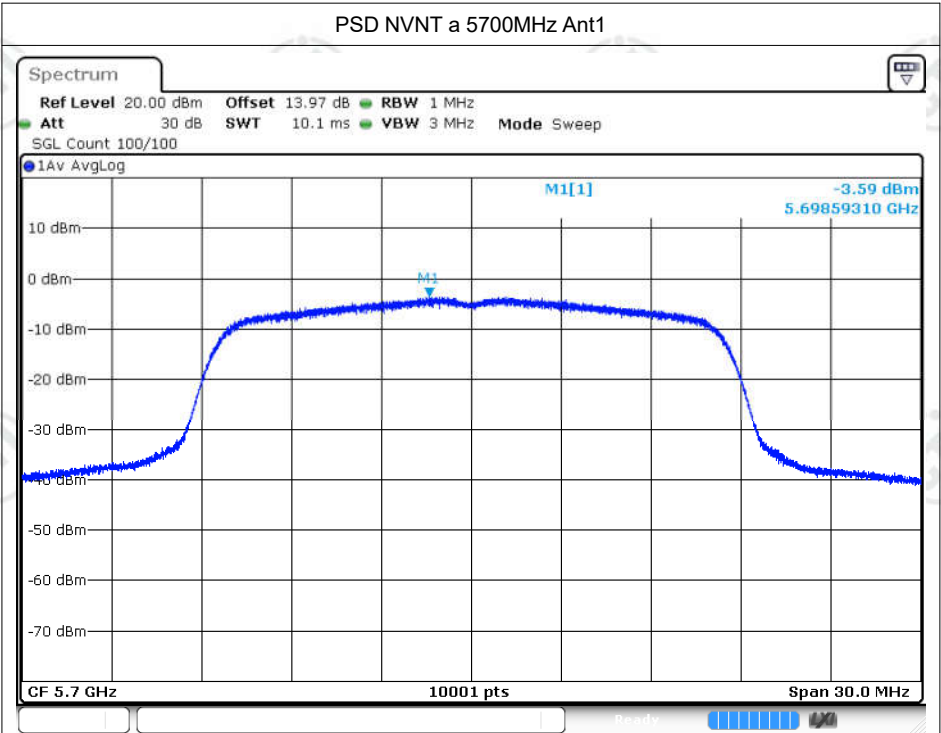


Date: 5.MAY.2024 12:45:54

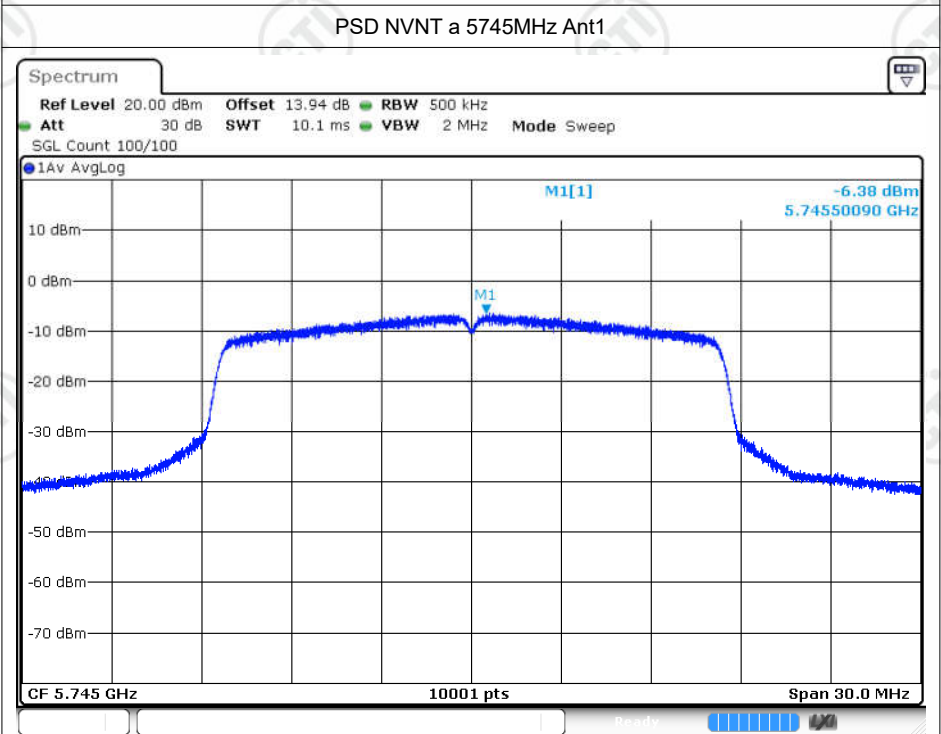


Date: 5.MAY.2024 12:32:07

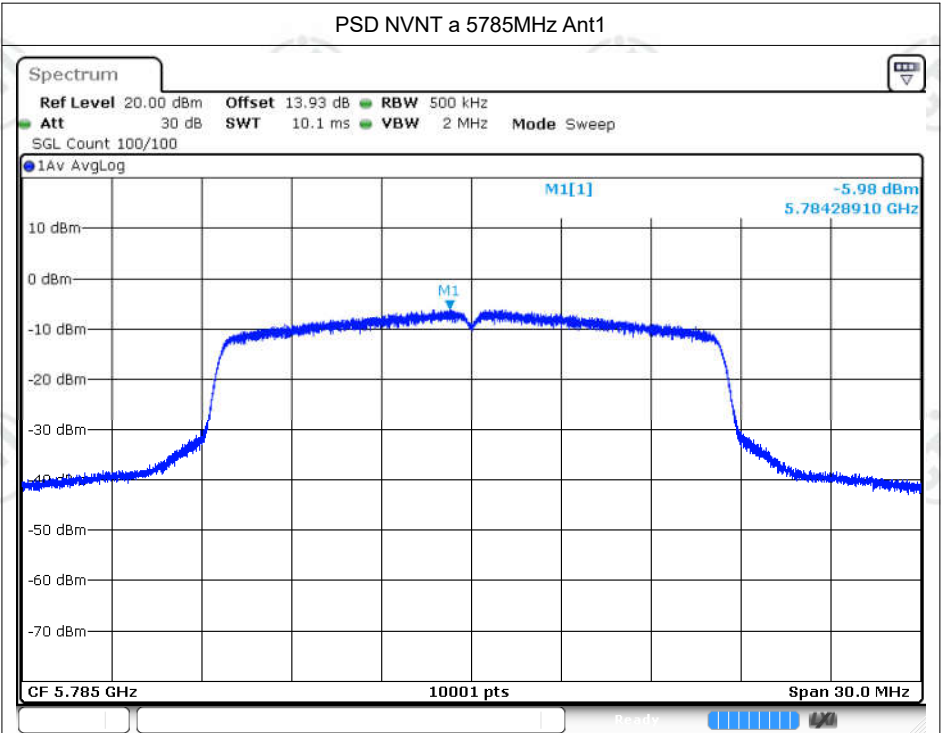


Date: 5.MAY.2024 12:33:52

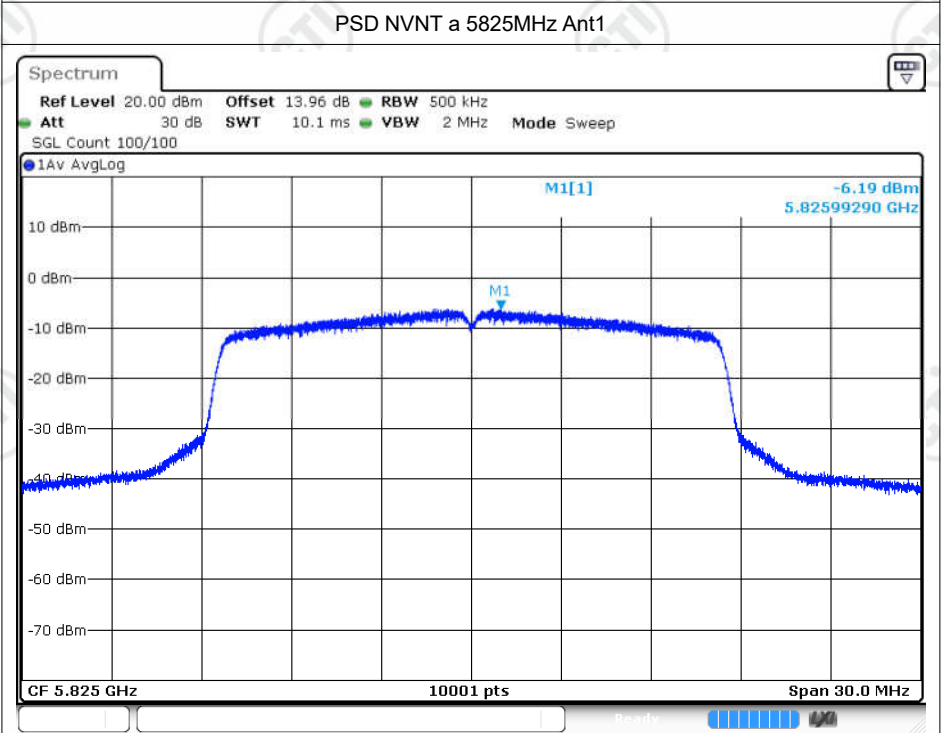


Date: 5.MAY.2024 12:34:46

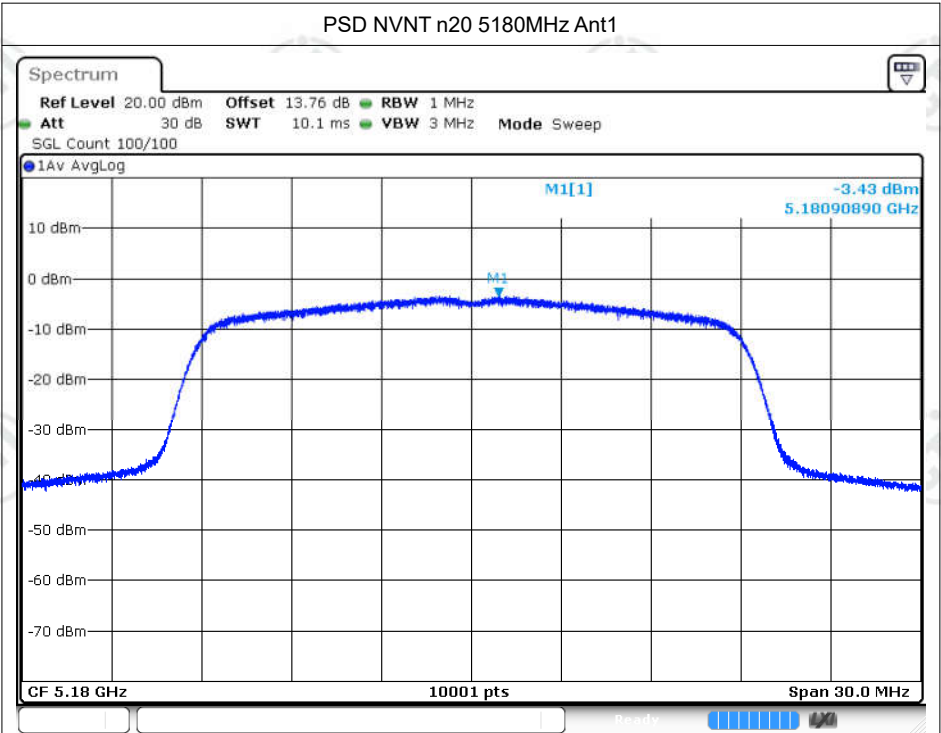


Date: 5.MAY.2024 12:49:19

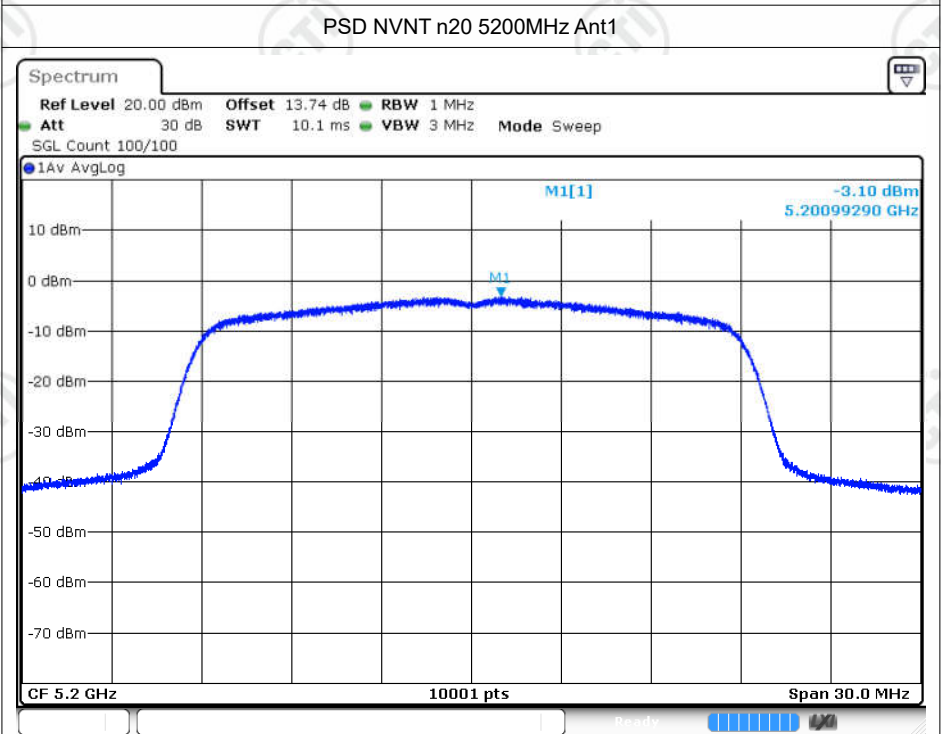


Date: 5.MAY.2024 12:53:06

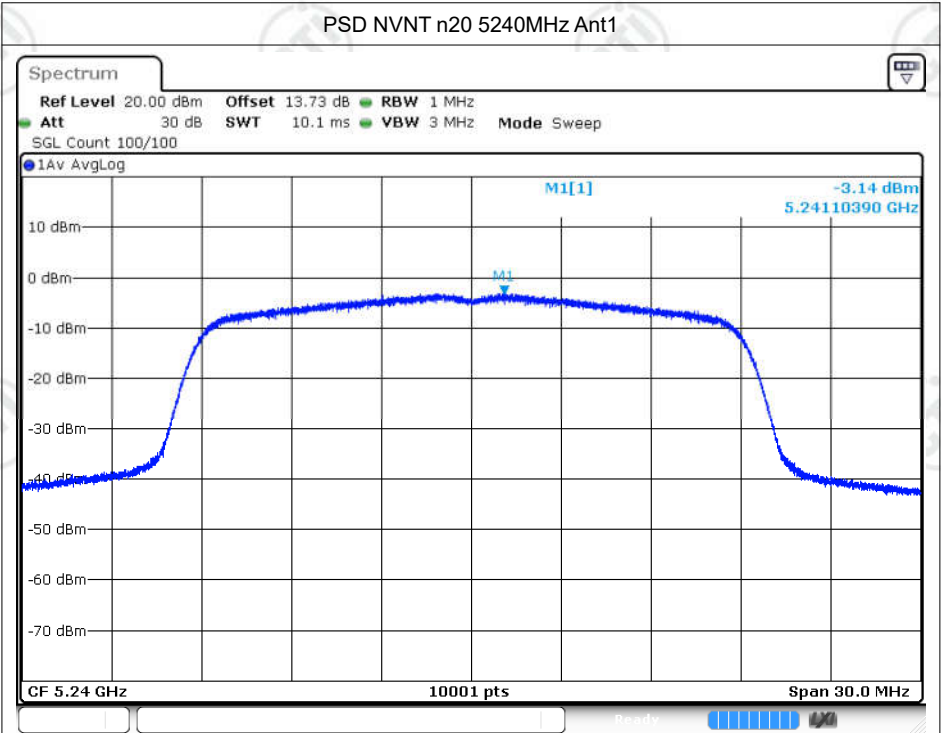


Date: 5.MAY.2024 12:53:55

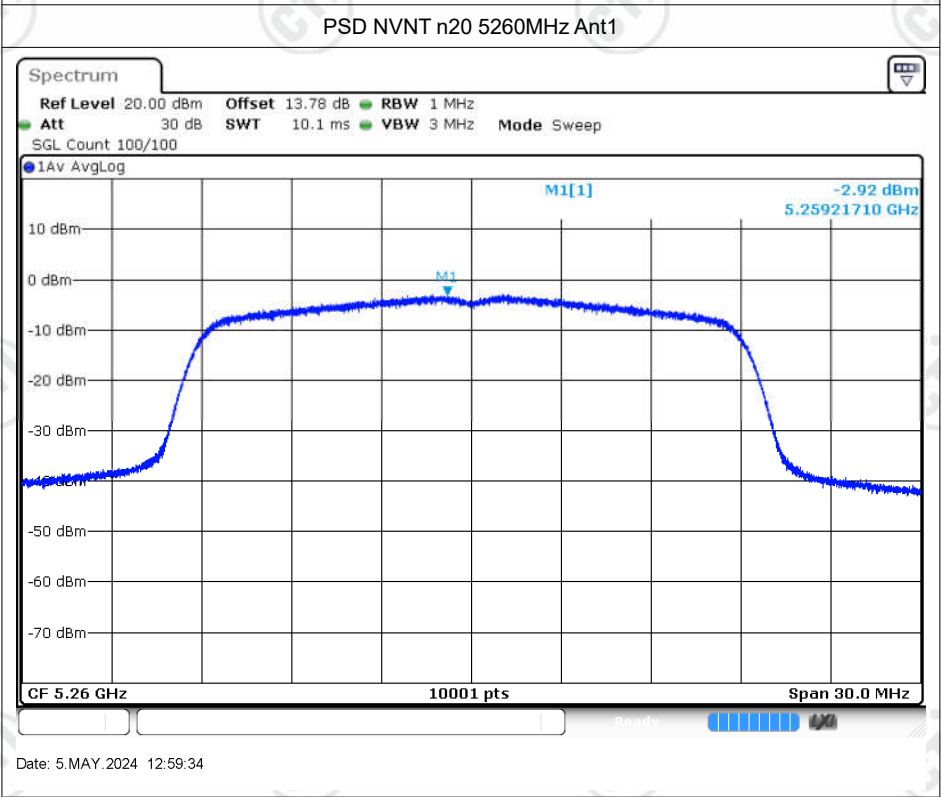


Date: 5.MAY.2024 12:59:34

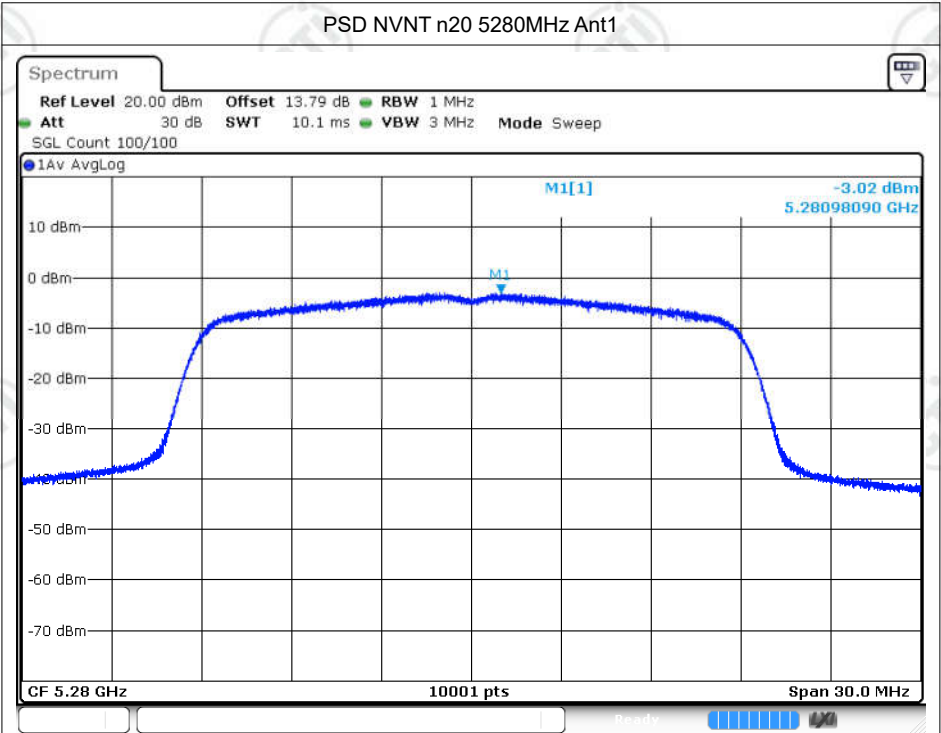


Date: 5.MAY.2024 13:01:03

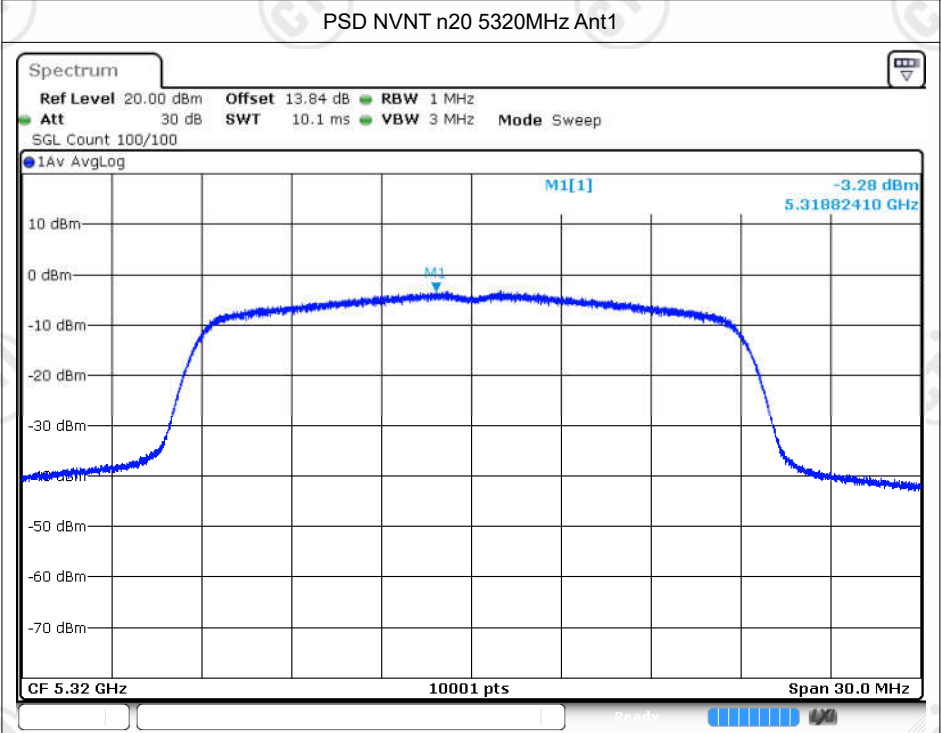


Date: 5.MAY.2024 13:02:58

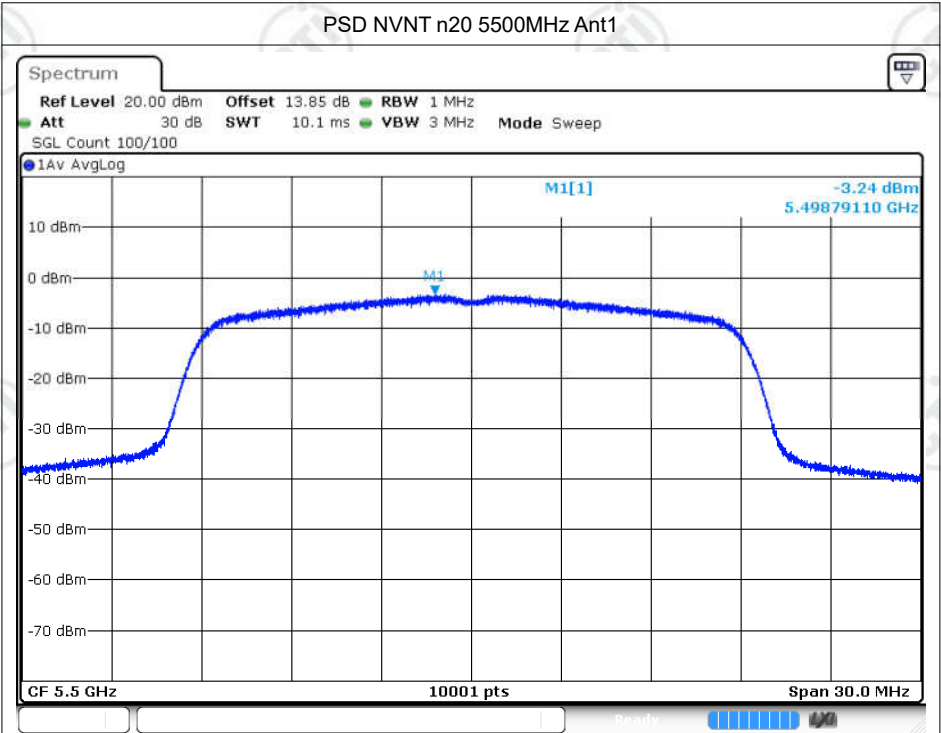


Date: 5.MAY.2024 13:04:43

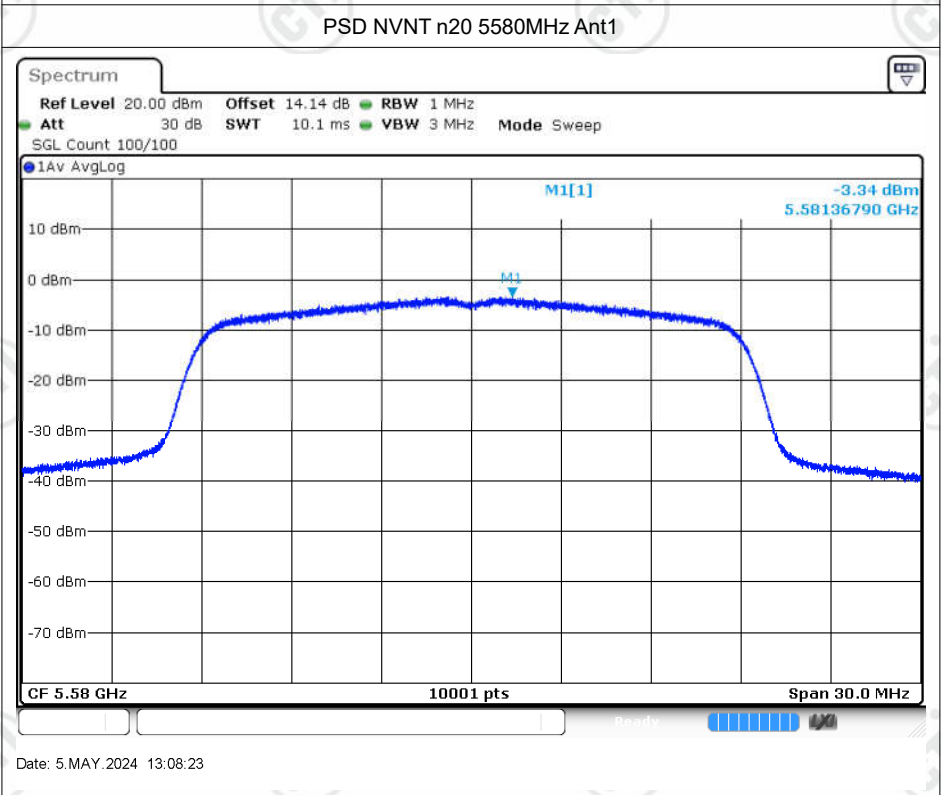


Date: 5.MAY.2024 13:08:23

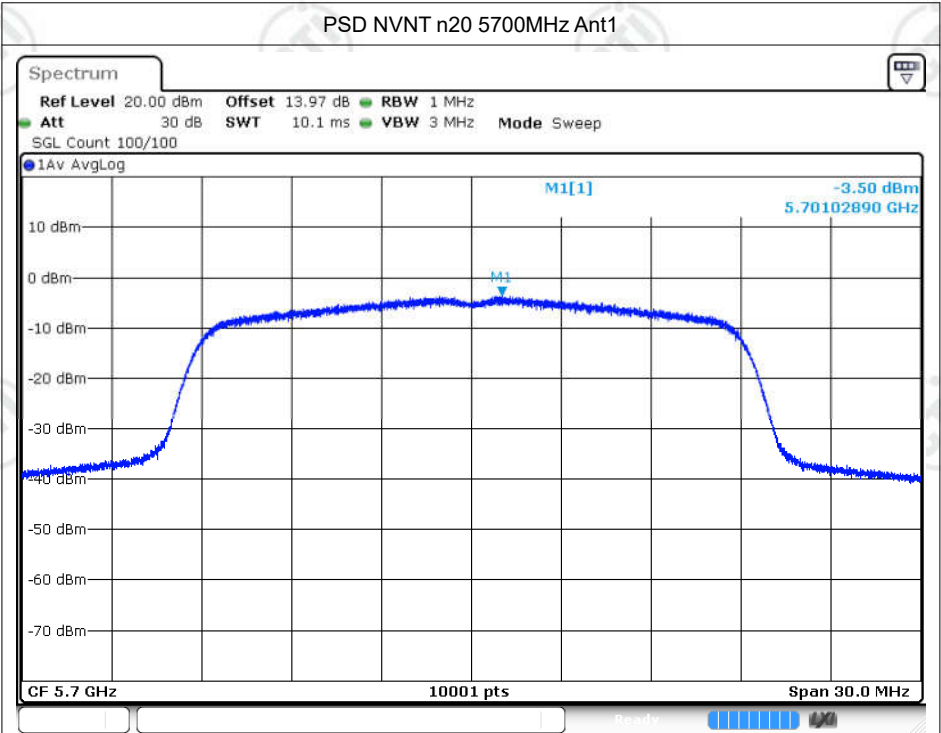


Date: 5.MAY.2024 13:07:08

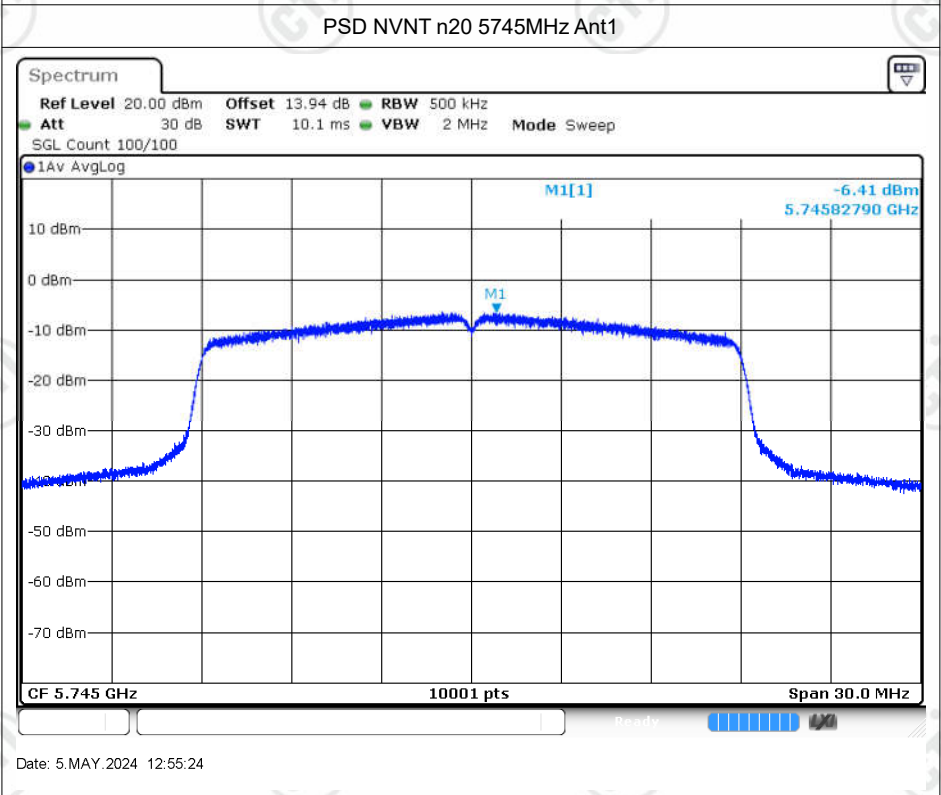


Date: 5.MAY.2024 12:55:24

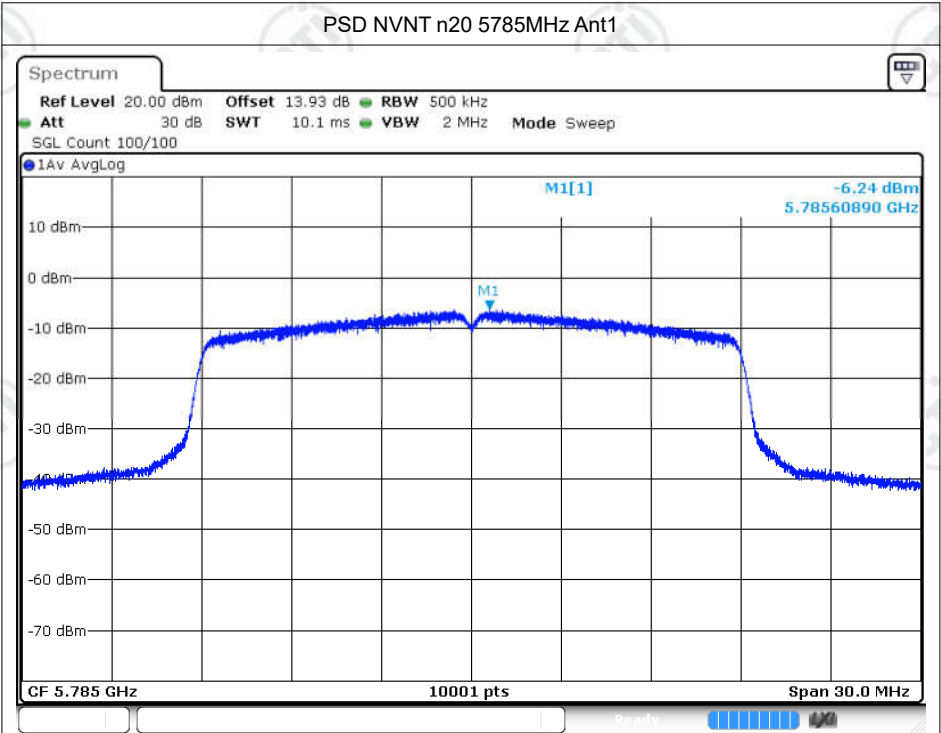


Date: 5.MAY.2024 12:56:55

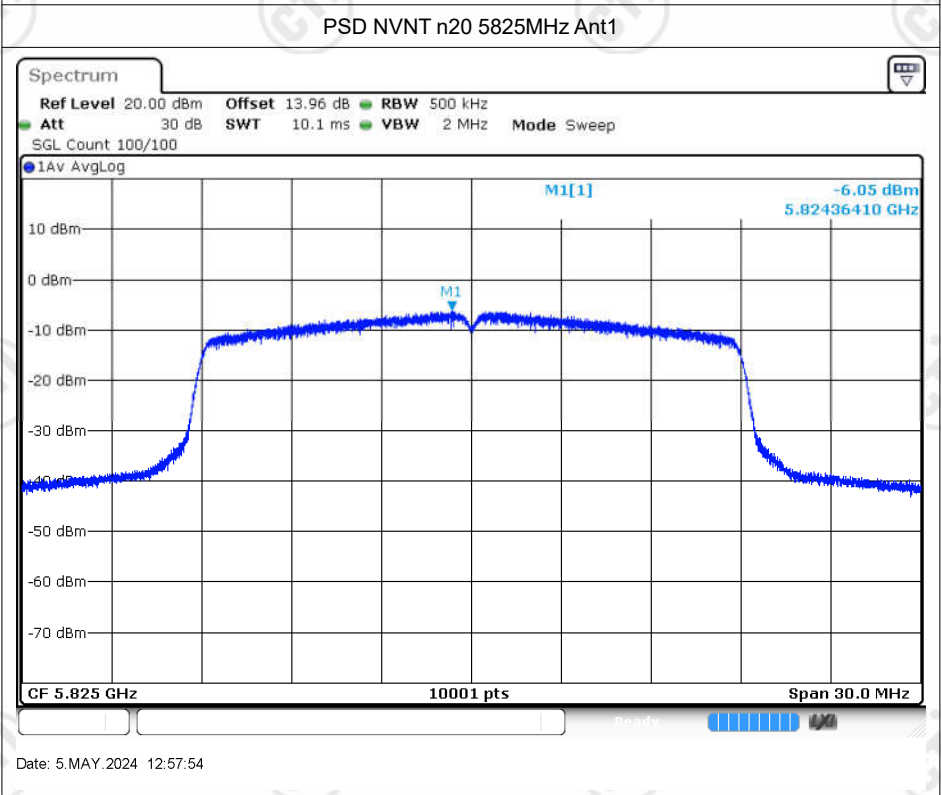


Date: 5.MAY.2024 12:57:54

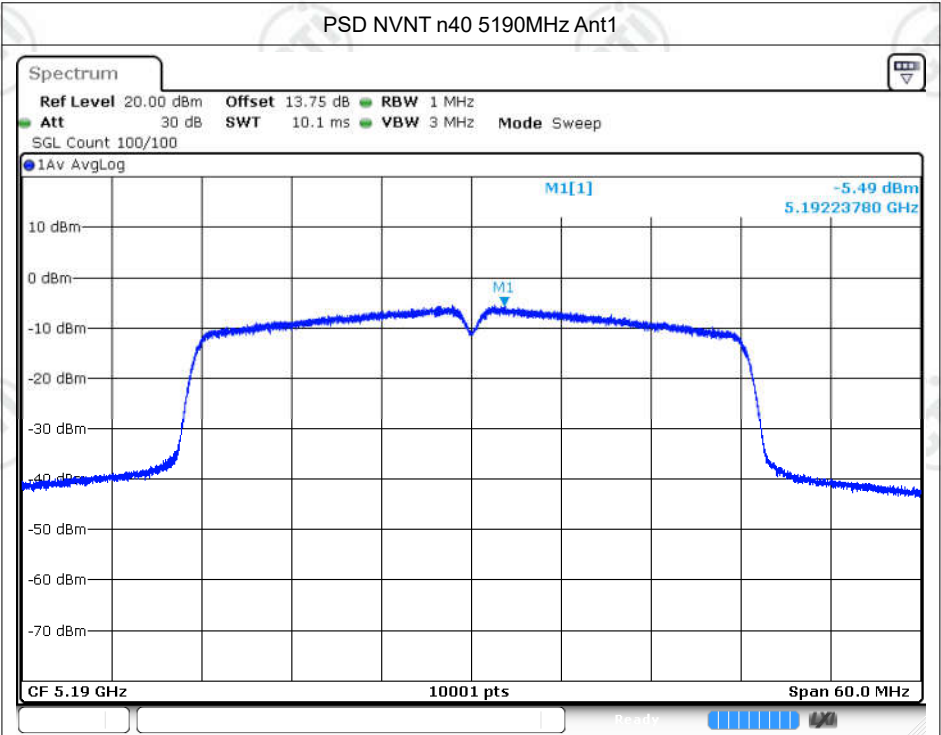


Date: 5.MAY.2024 13:10:37

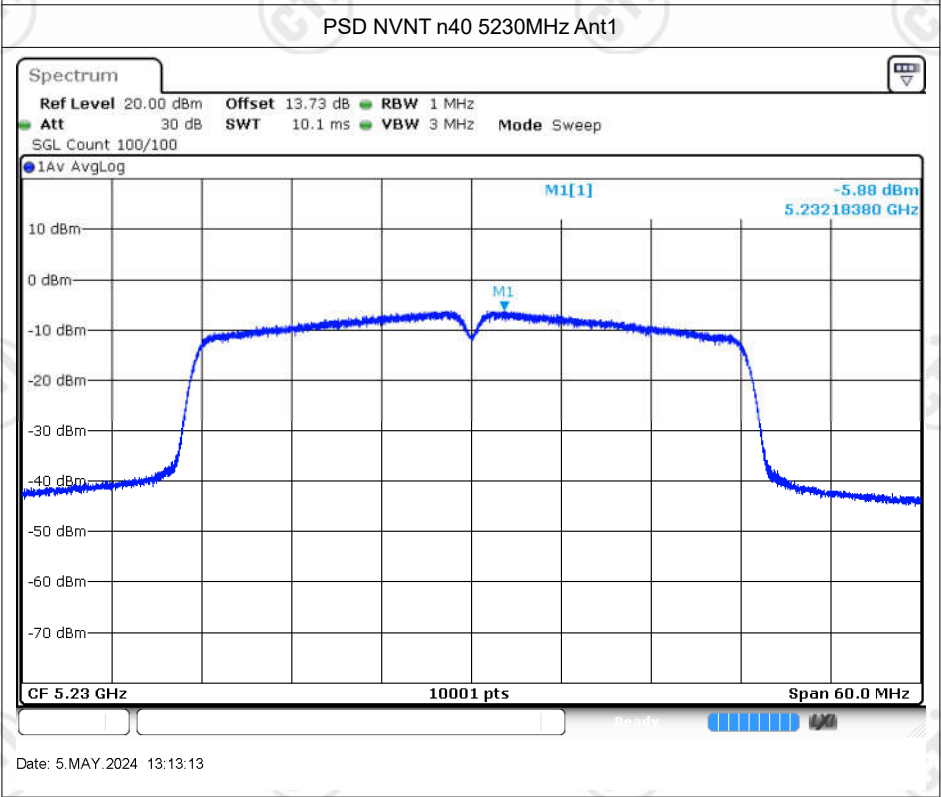


Date: 5.MAY.2024 13:13:13

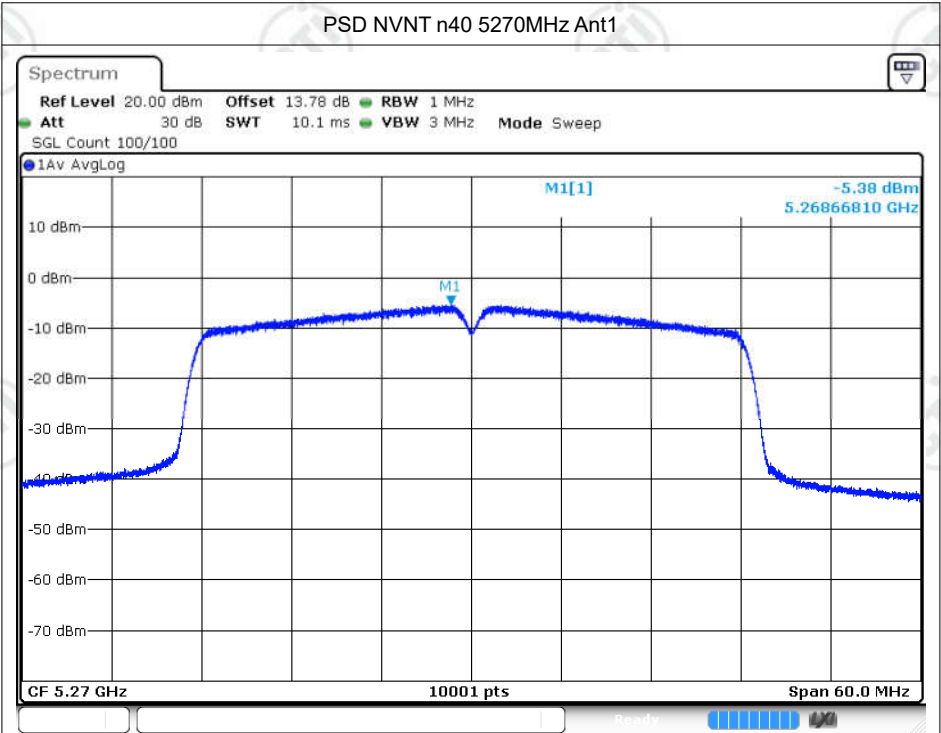


Date: 5.MAY.2024 13:18:39

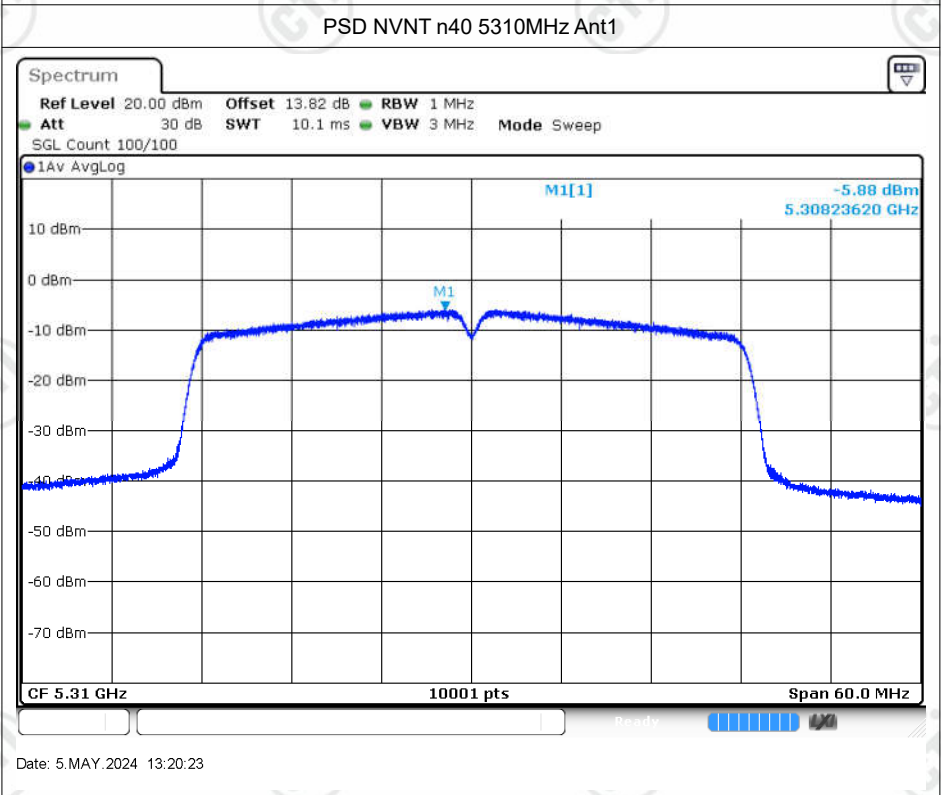


Date: 5.MAY.2024 13:20:23

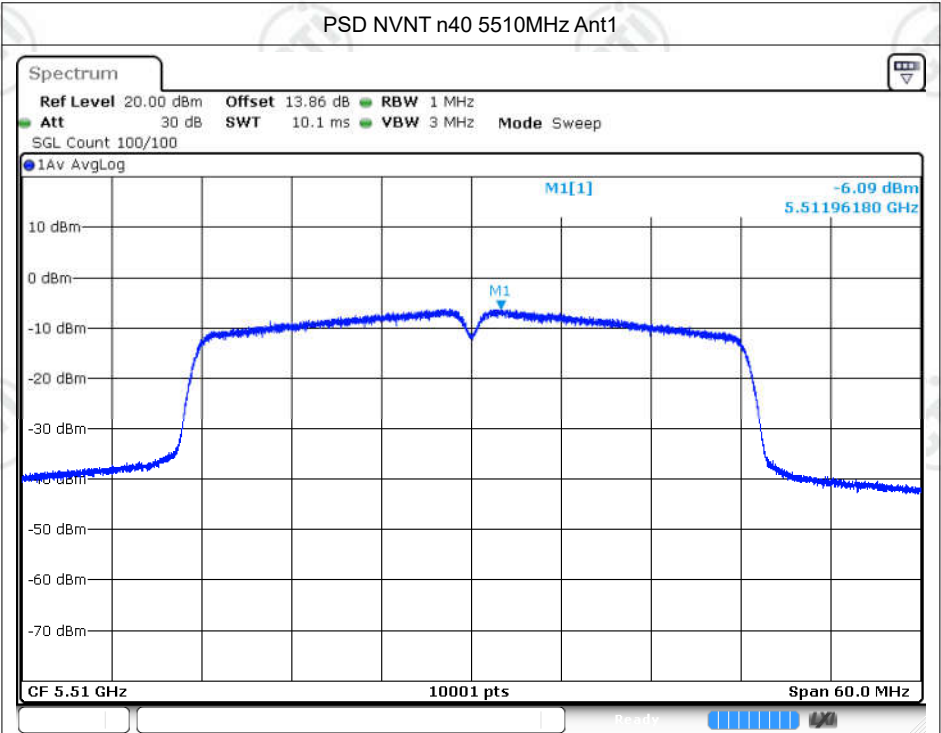


Date: 5.MAY.2024 13:22:17

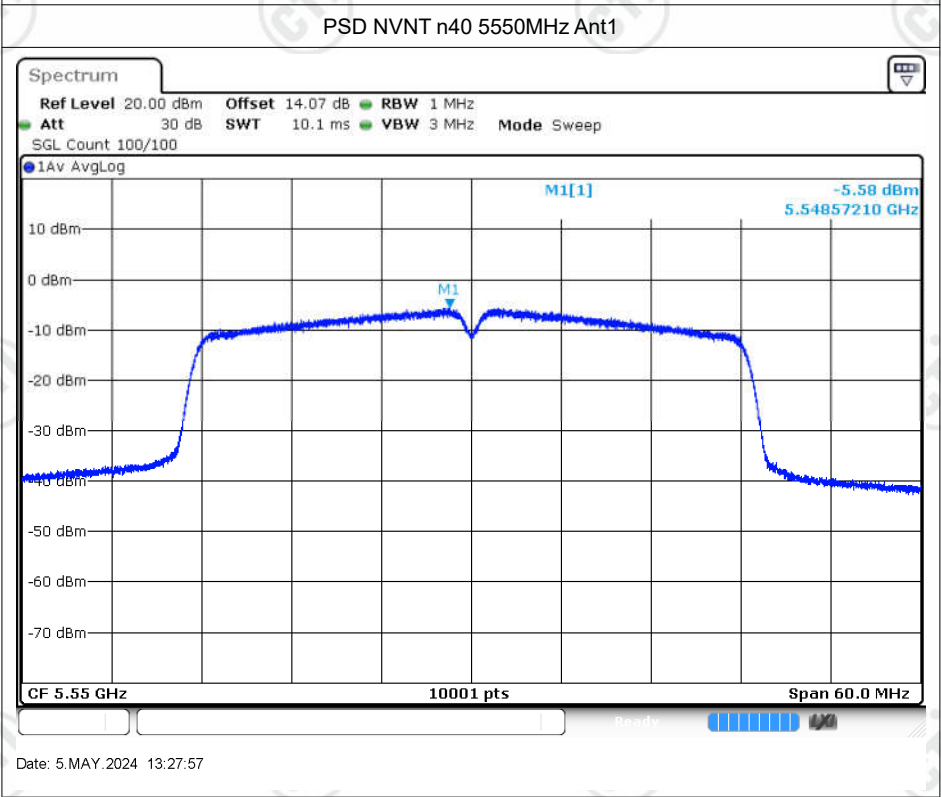


Date: 5.MAY.2024 13:27:57

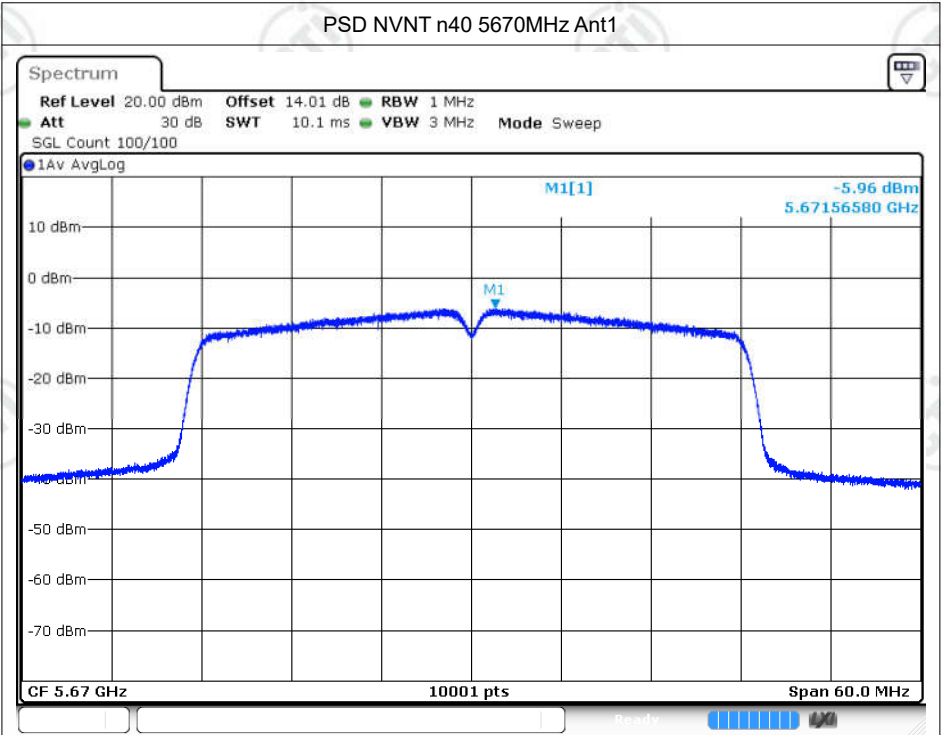


Date: 5.MAY.2024 13:29:51

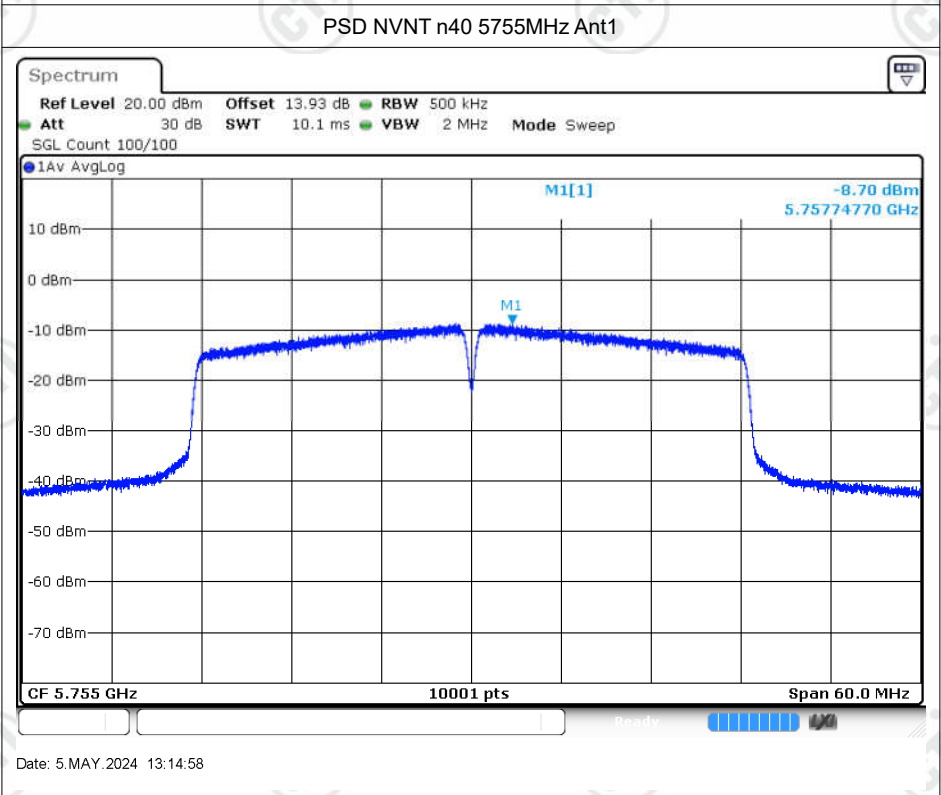


Date: 5.MAY.2024 13:14:58

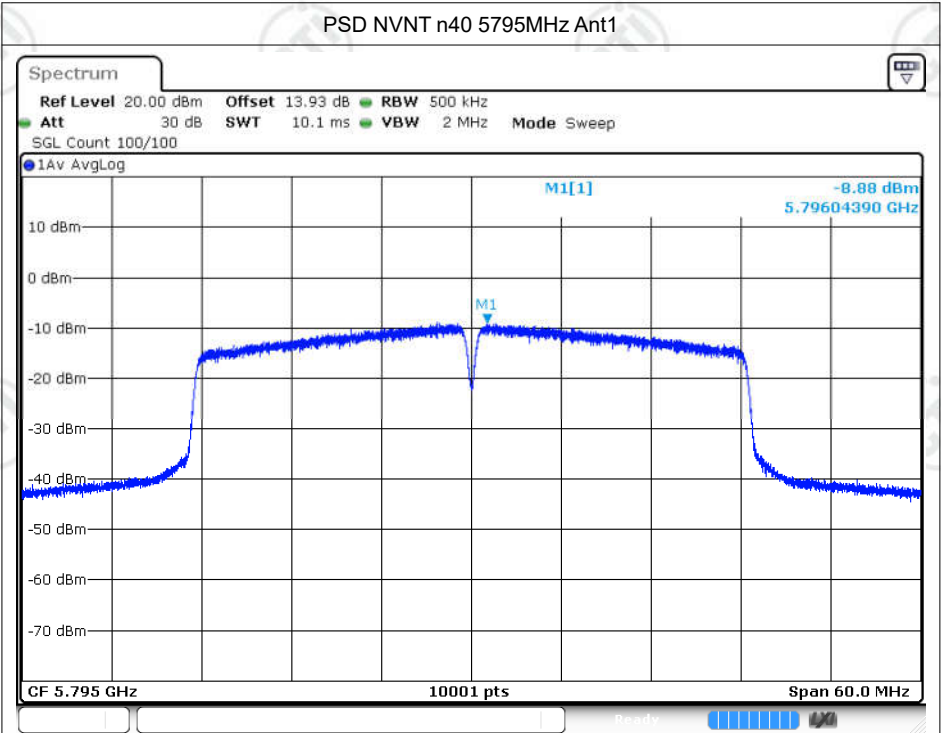


Date: 5.MAY.2024 13:16:54

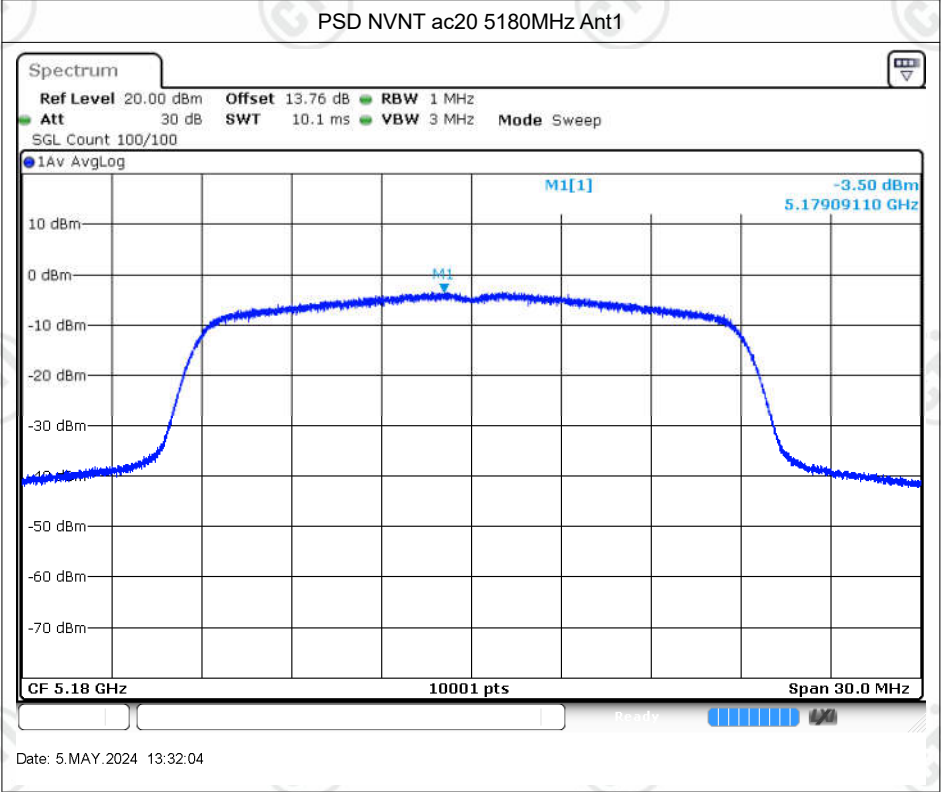


Date: 5.MAY.2024 13:32:04

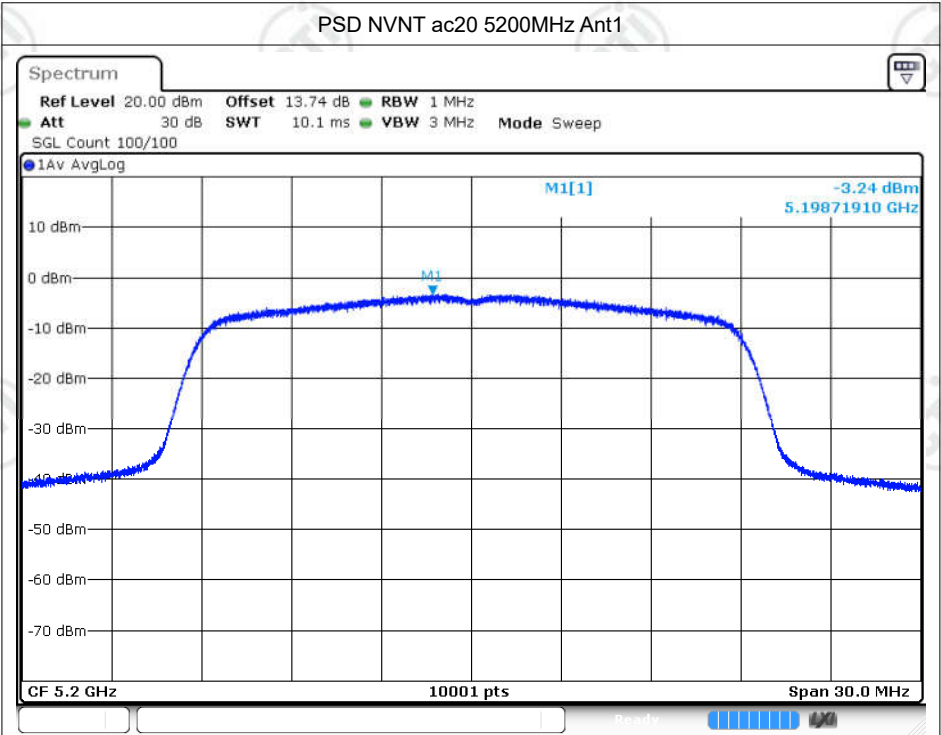


Date: 5.MAY.2024 13:33:35

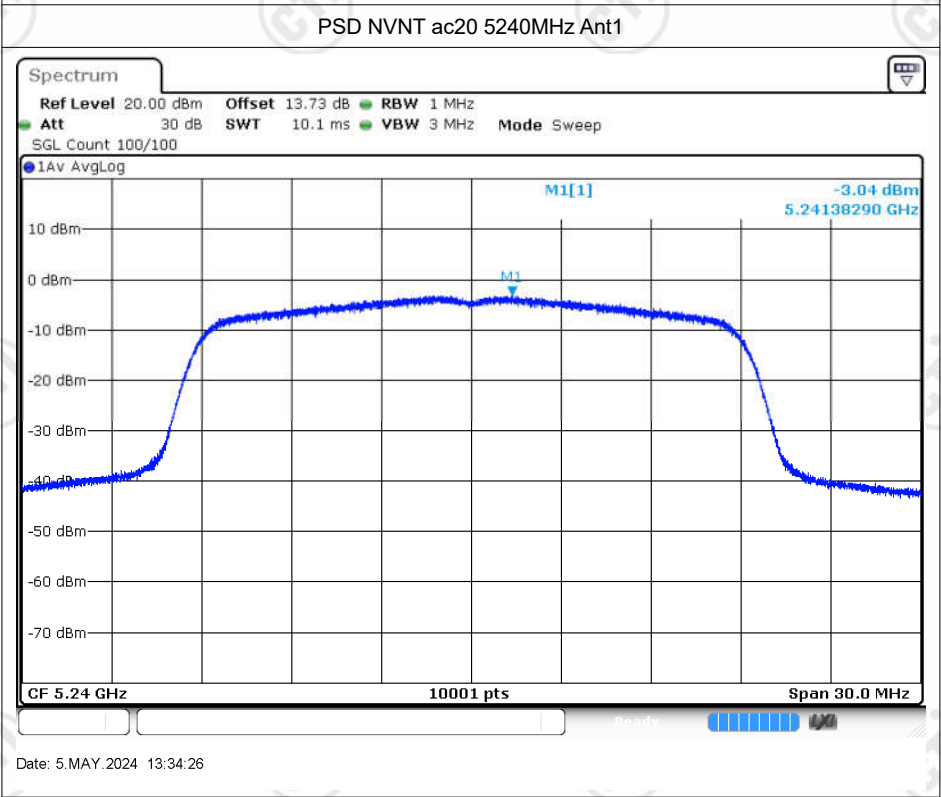


Date: 5.MAY.2024 13:34:26

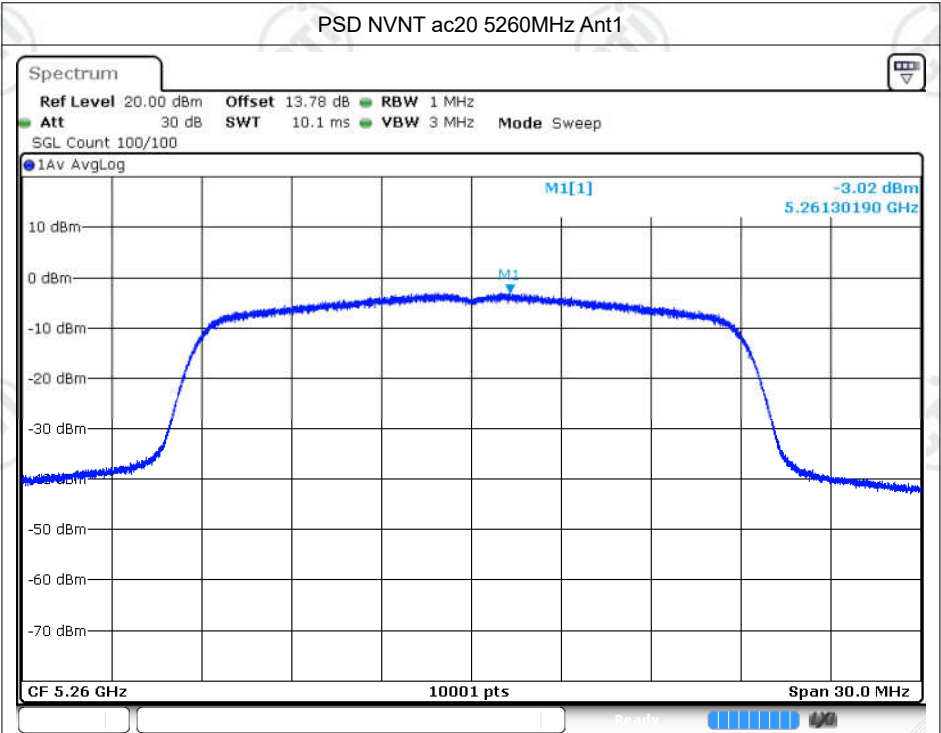


Date: 5.MAY.2024 13:39:51

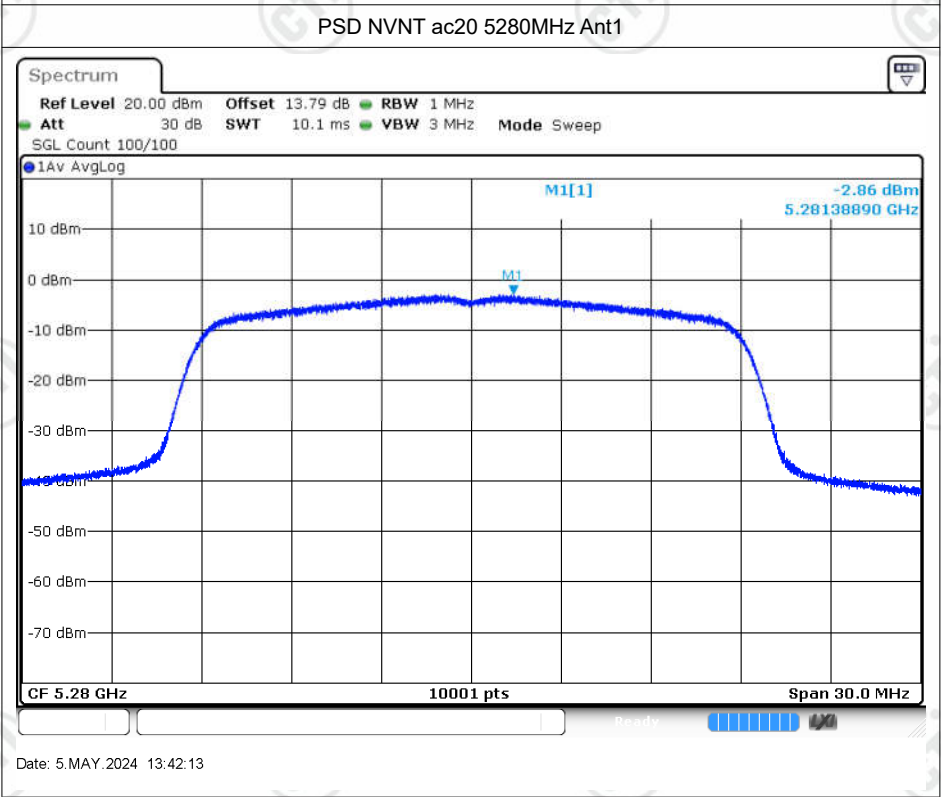


Date: 5.MAY.2024 13:42:13

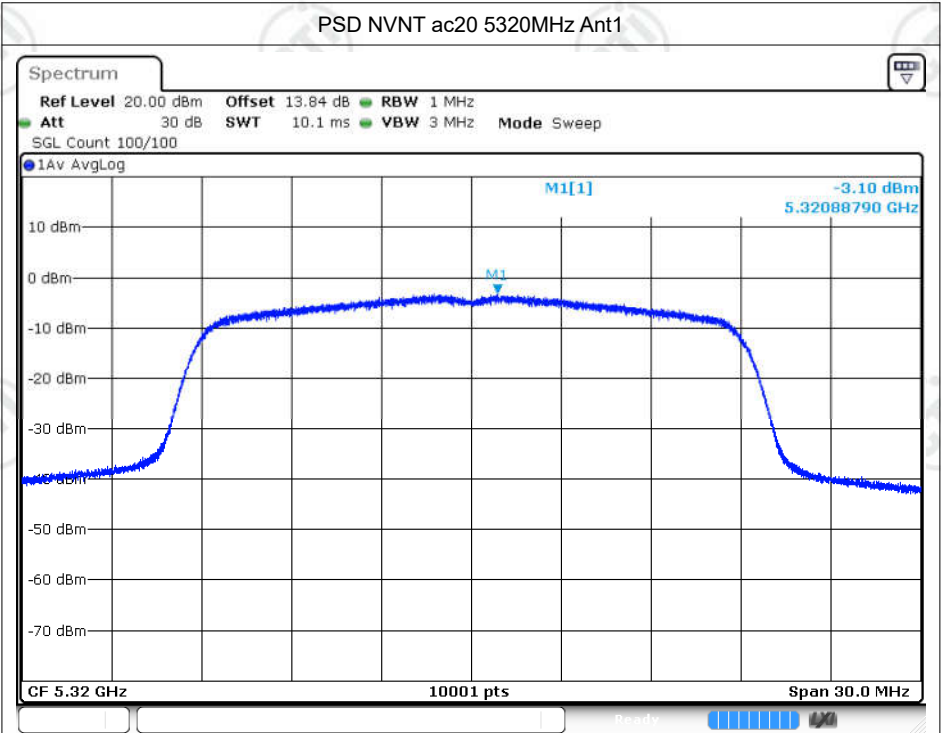


Date: 5.MAY.2024 13:43:57

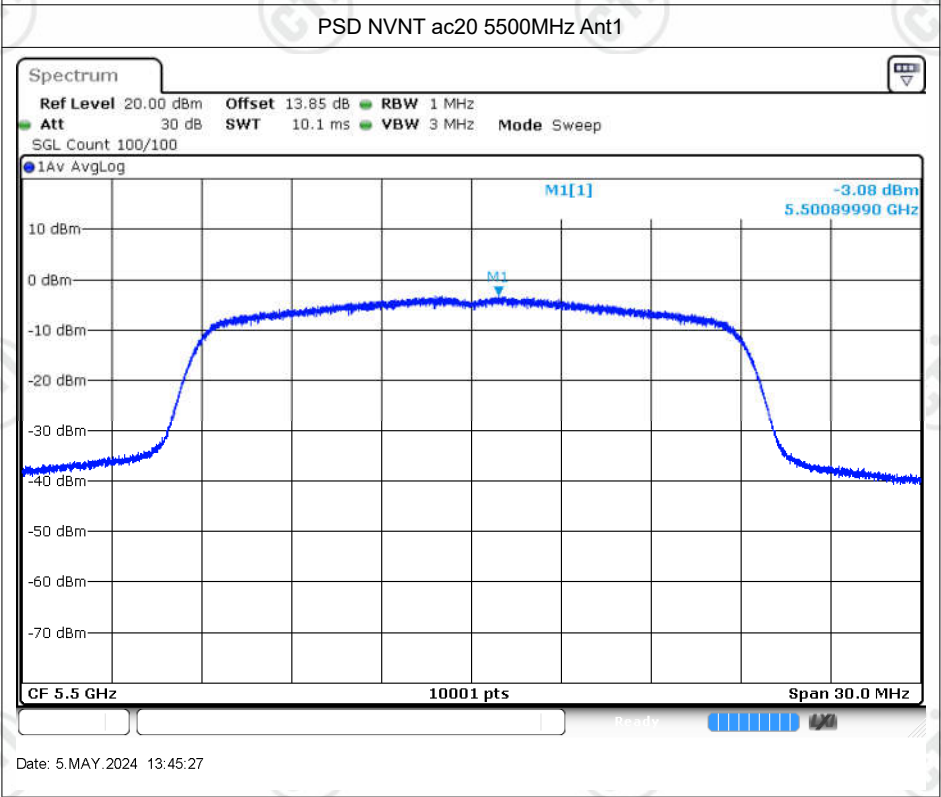


Date: 5.MAY.2024 13:45:27

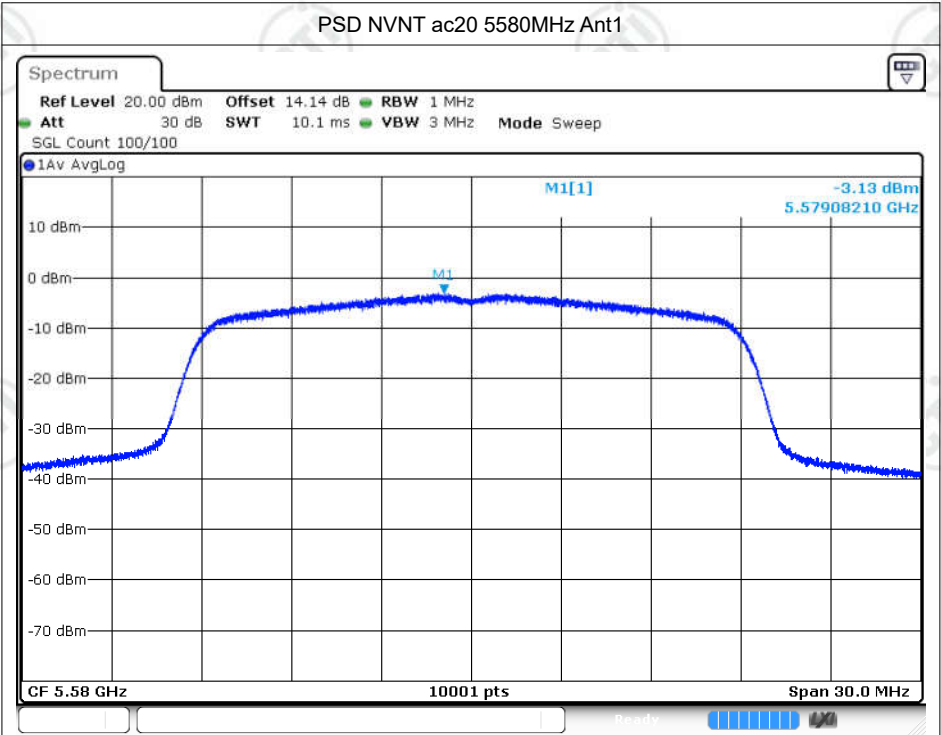


Date: 5.MAY.2024 13:48:32

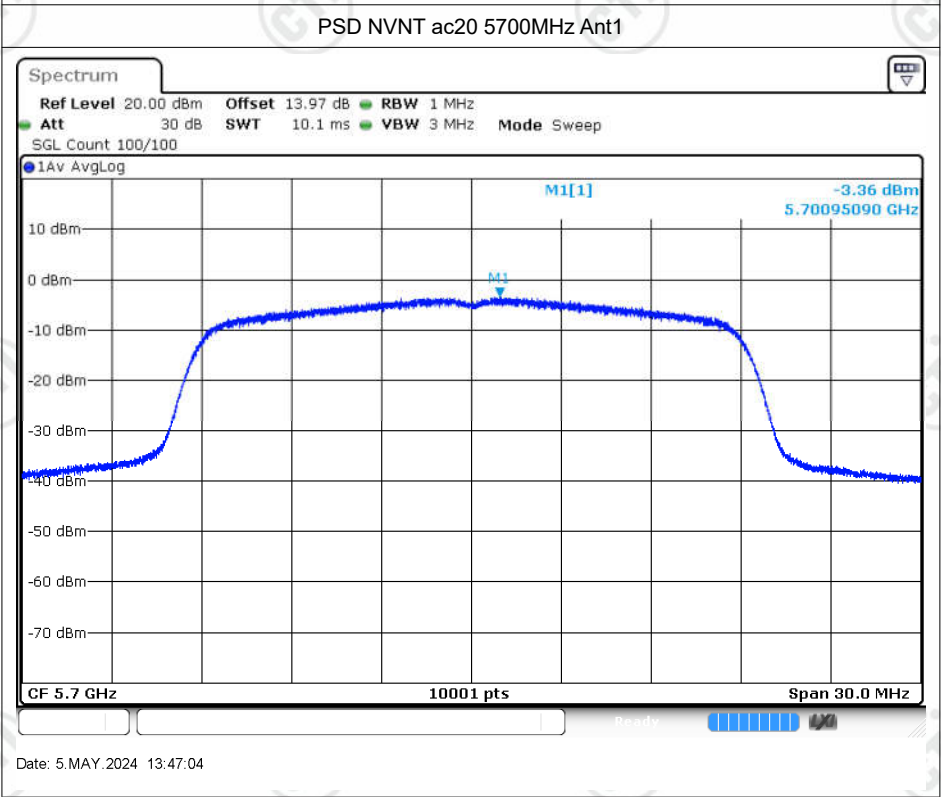


Date: 5.MAY.2024 13:47:04

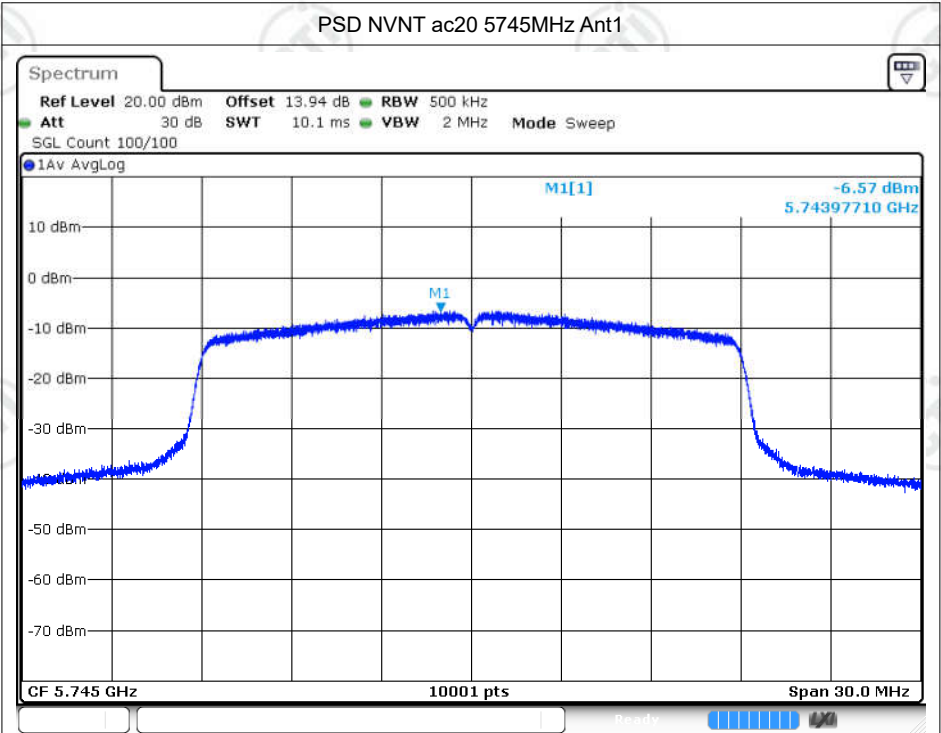


Date: 5.MAY.2024 13:35:56

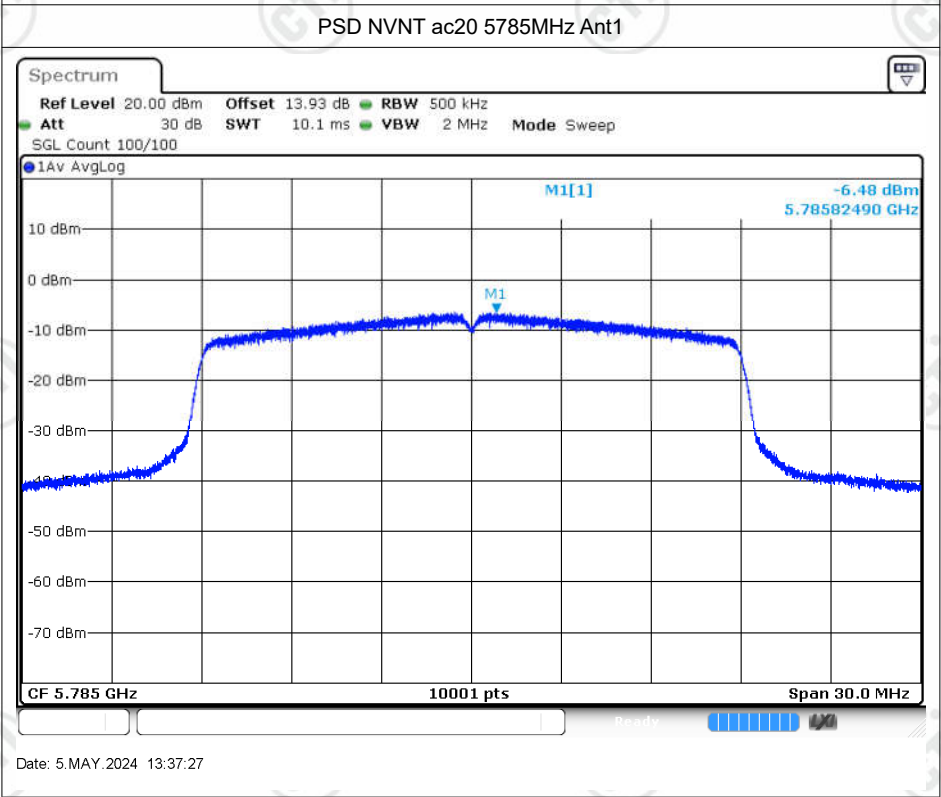


Date: 5.MAY.2024 13:37:27

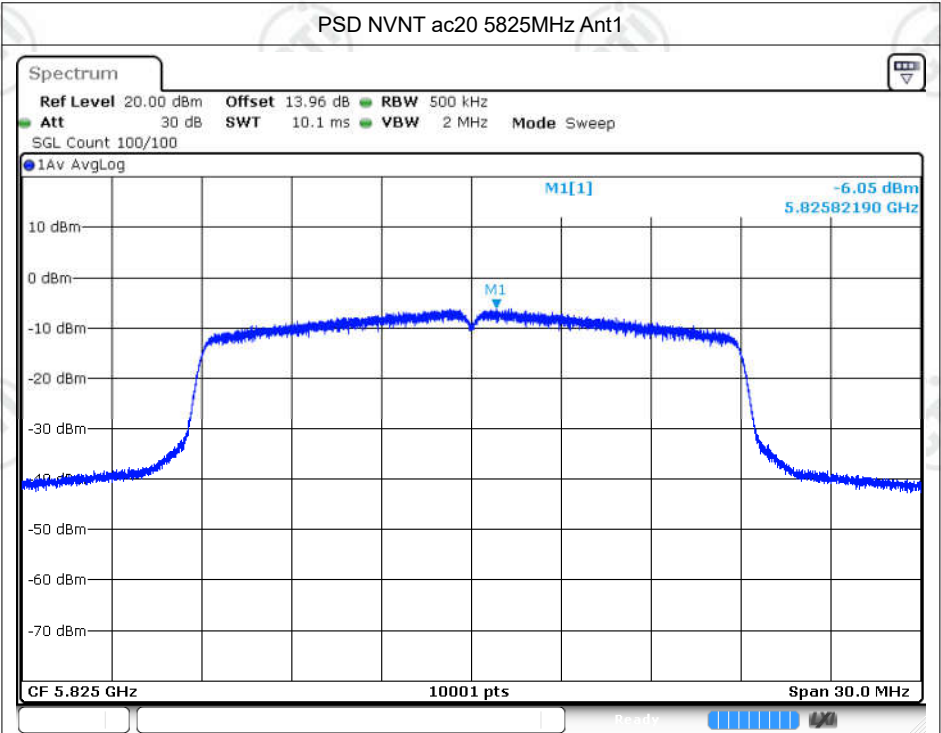


Date: 5.MAY.2024 13:38:17

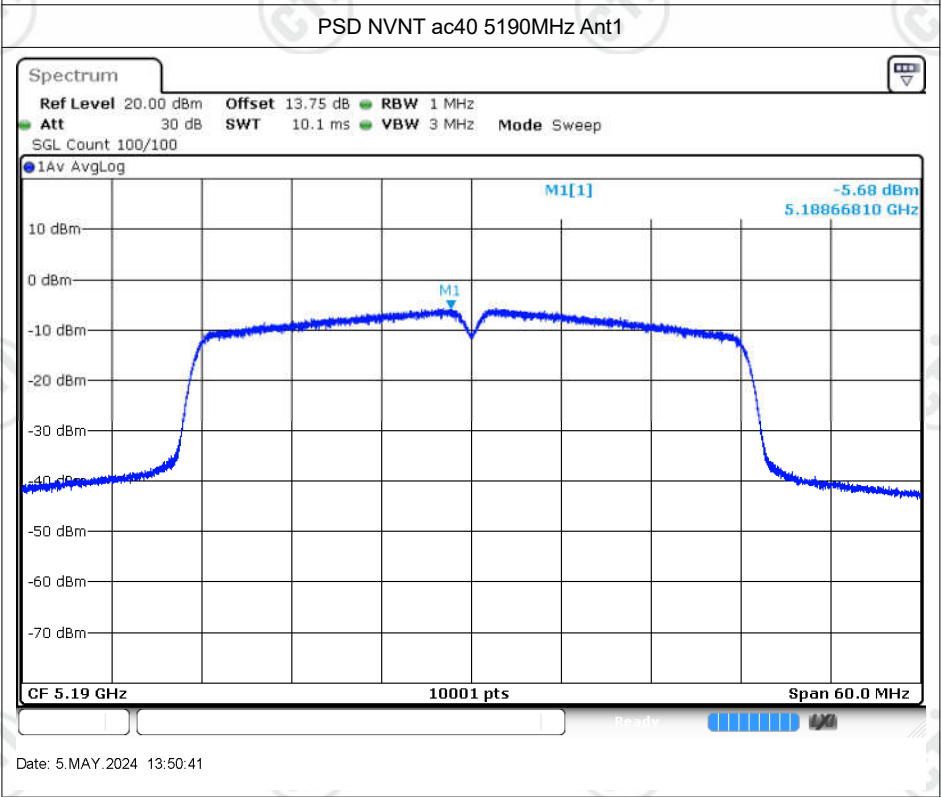


Date: 5.MAY.2024 13:50:41

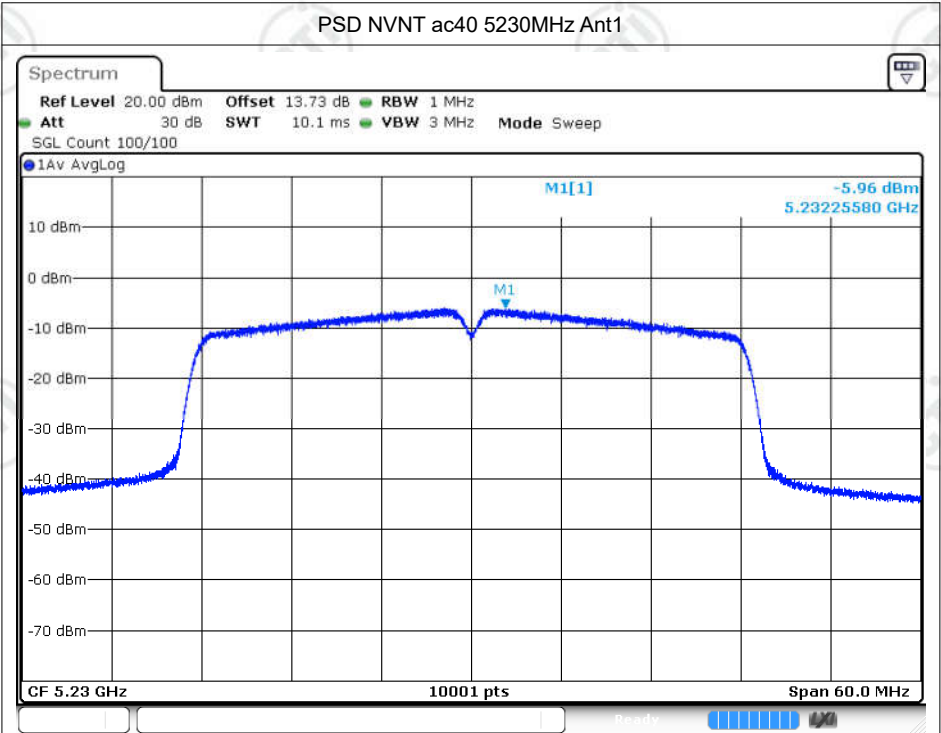


Date: 5.MAY.2024 13:52:29

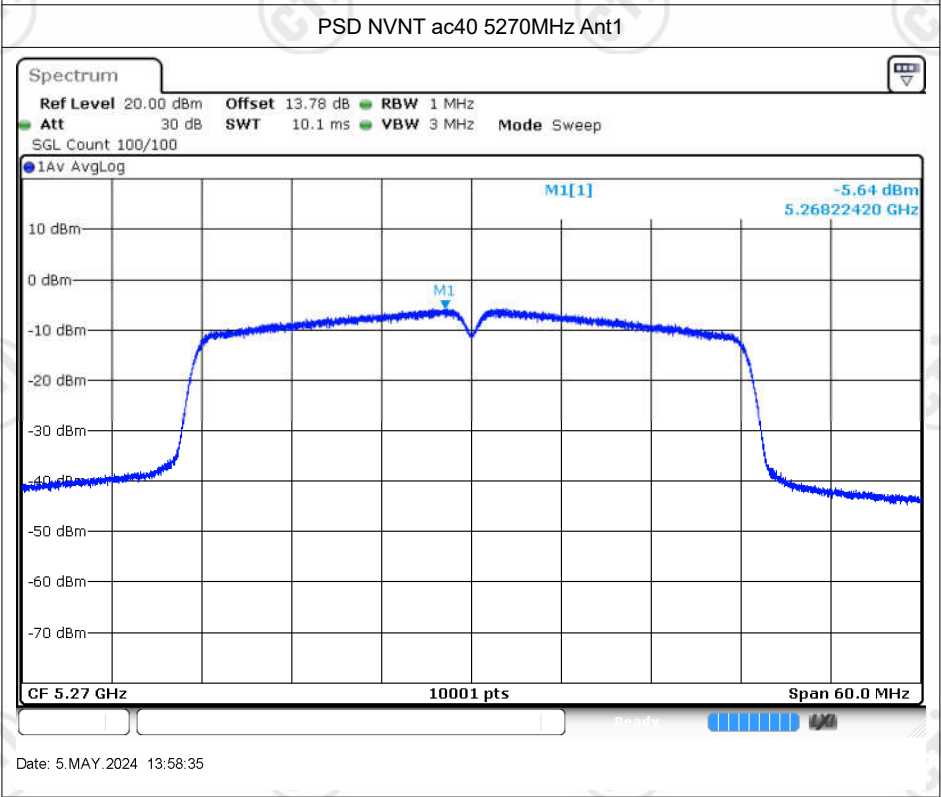


Date: 5.MAY.2024 13:58:35

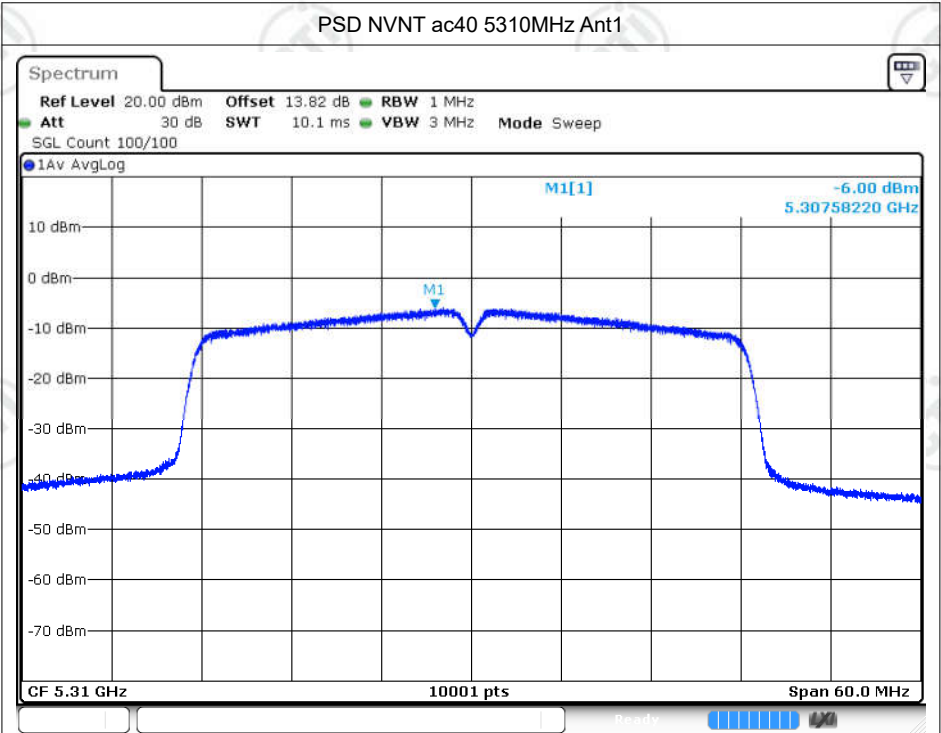


Date: 5.MAY.2024 14:00:24

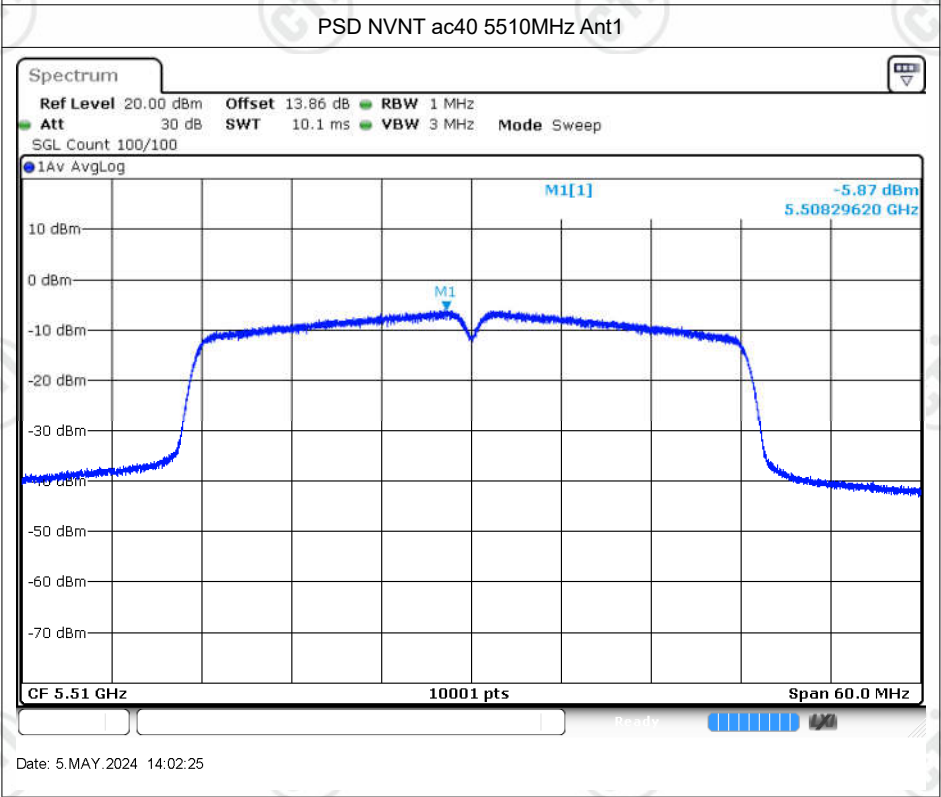


Date: 5.MAY.2024 14:02:25

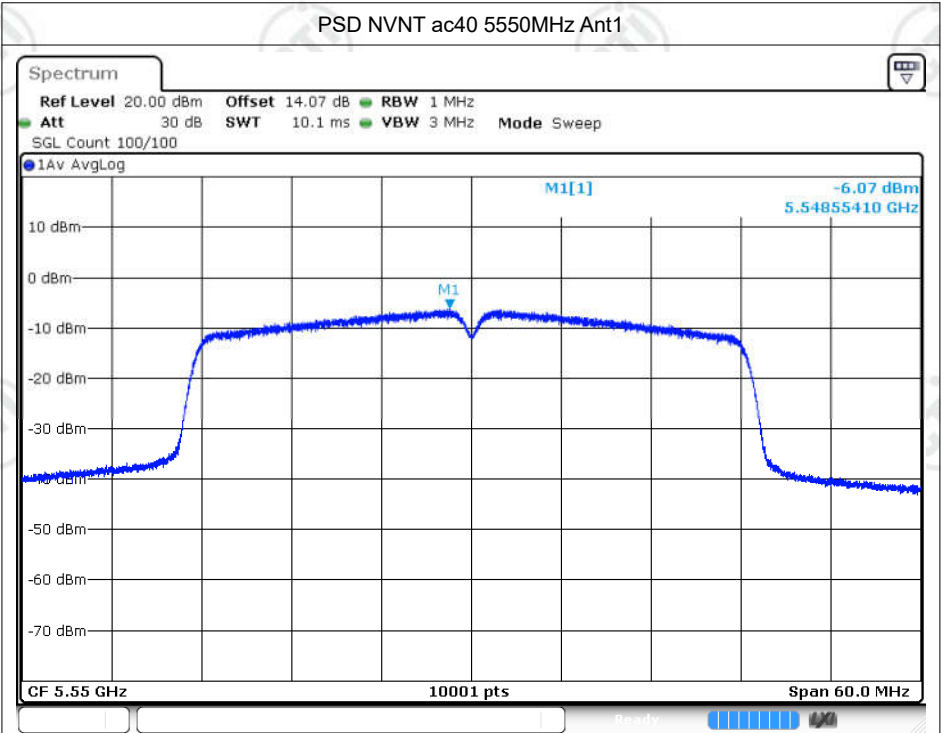


Date: 5.MAY.2024 14:04:18

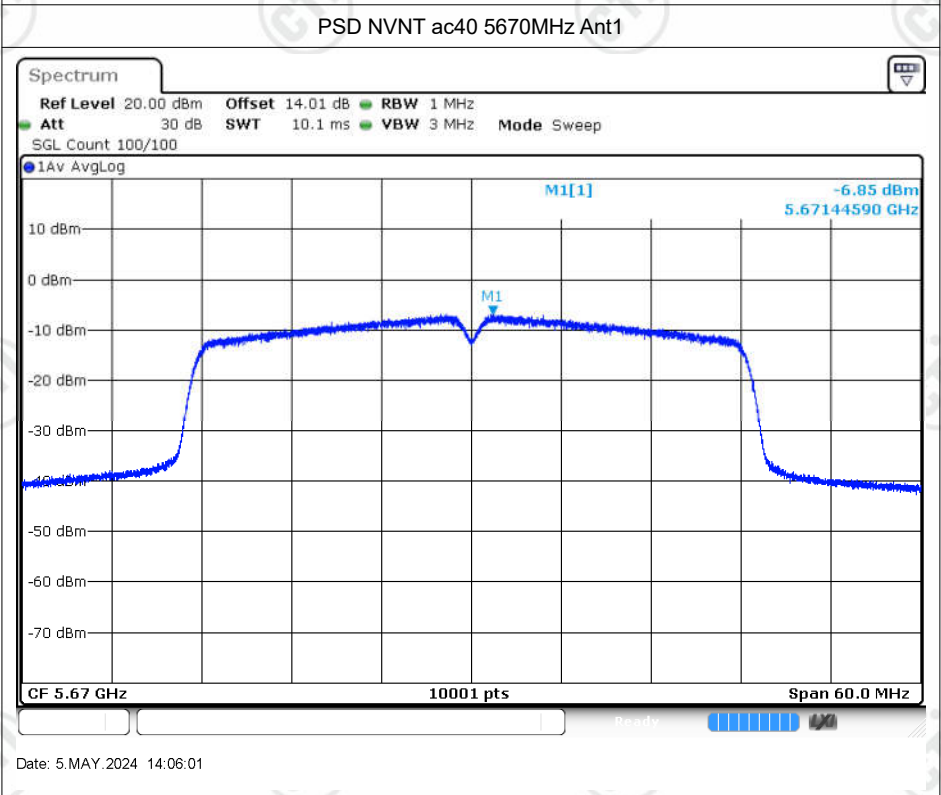


Date: 5.MAY.2024 14:06:01

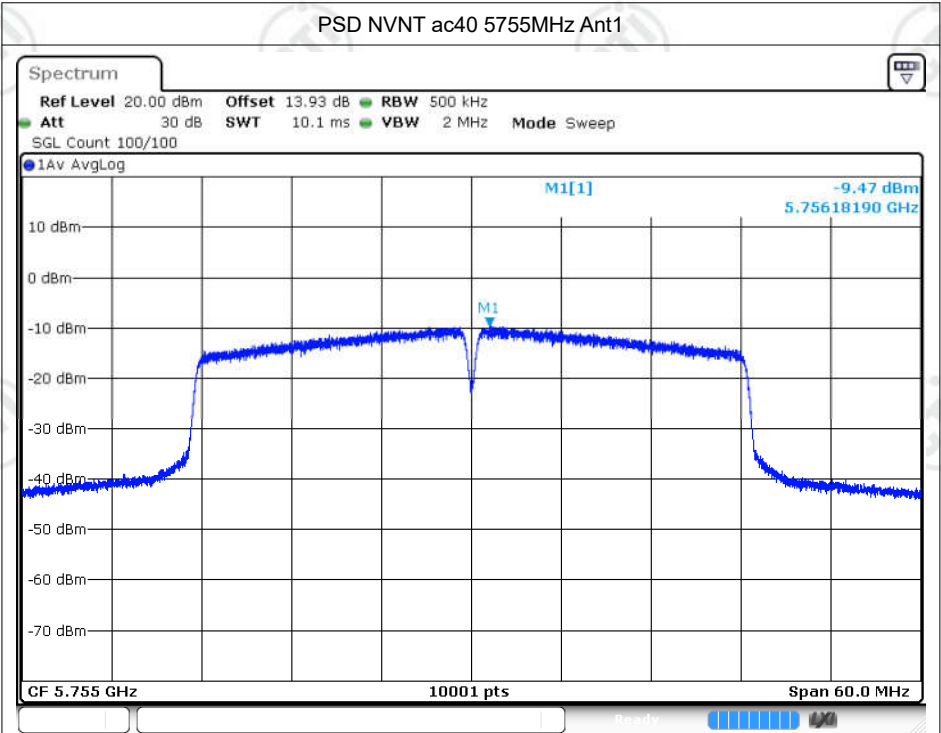


Date: 5.MAY.2024 13:54:29

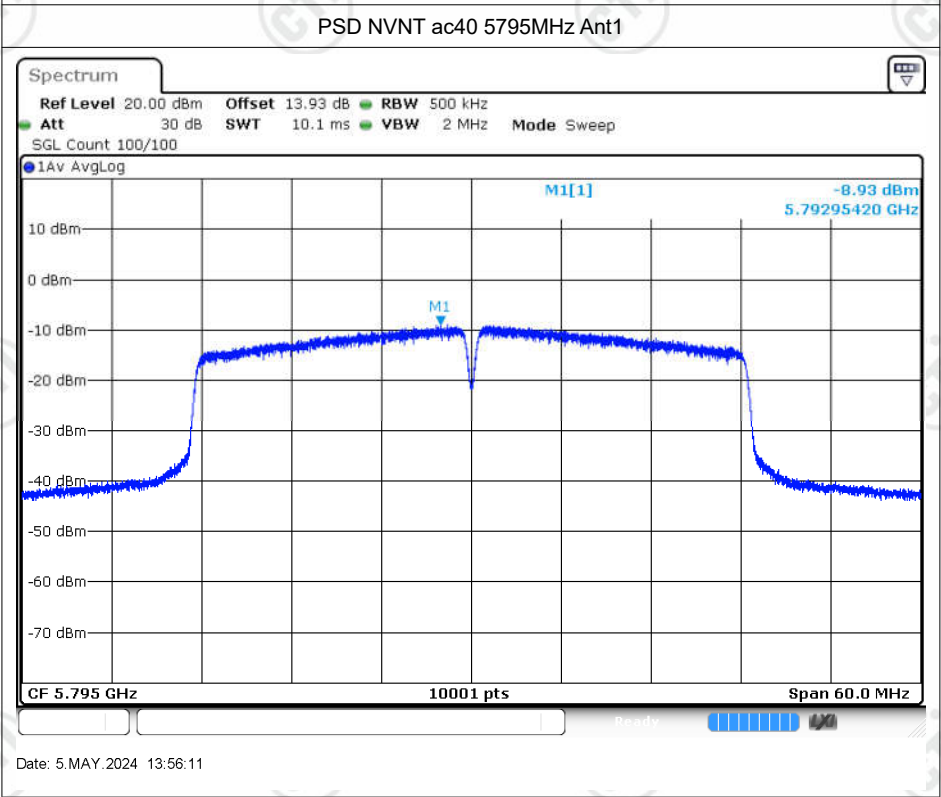


Date: 5.MAY.2024 13:56:11

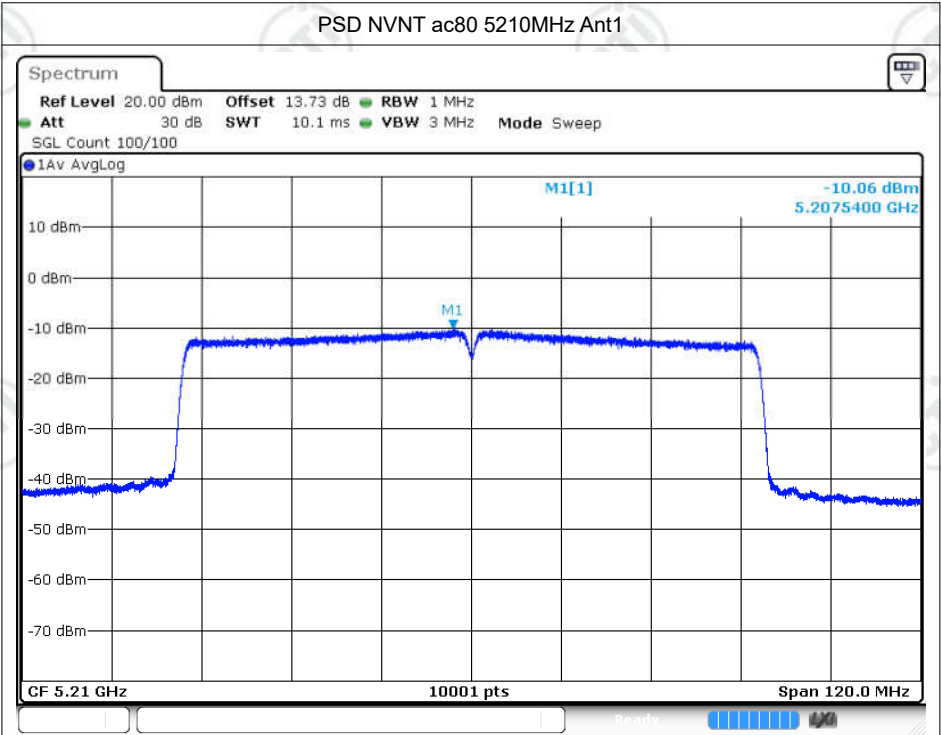


Date: 5.MAY.2024 14:09:45

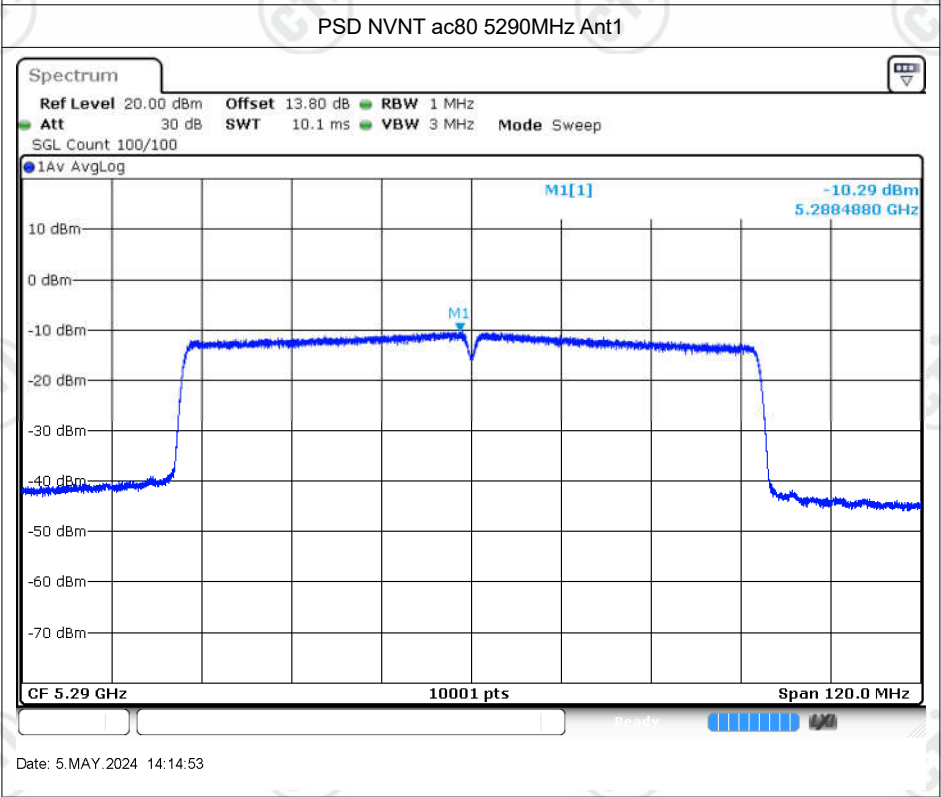

Date: 5.MAY.2024 14:14:53

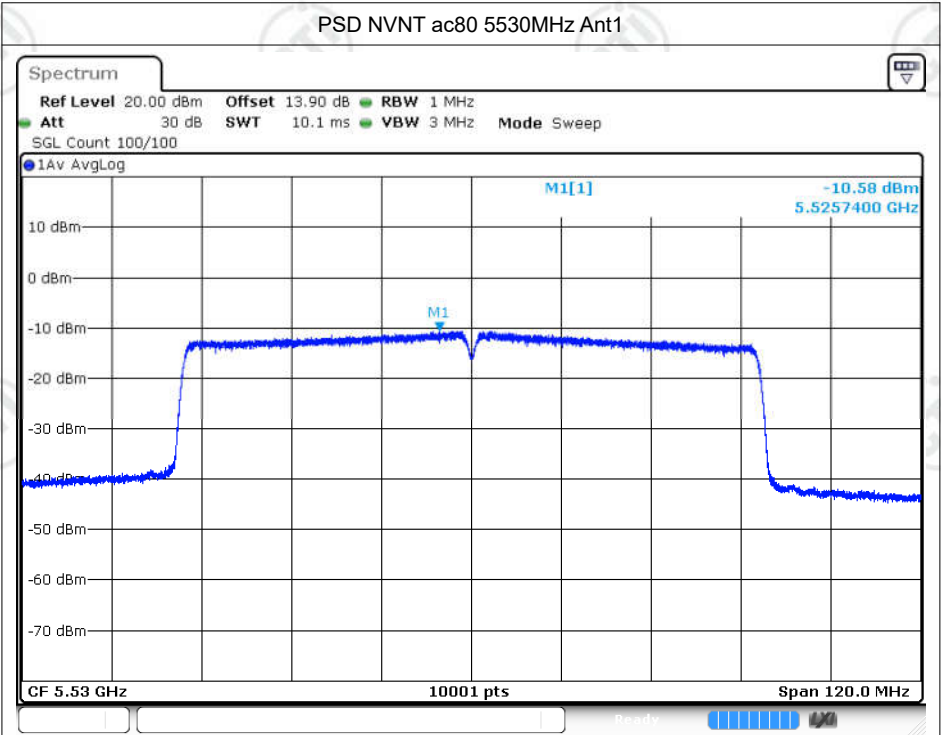

Date: 5.MAY.2024 14:17:20

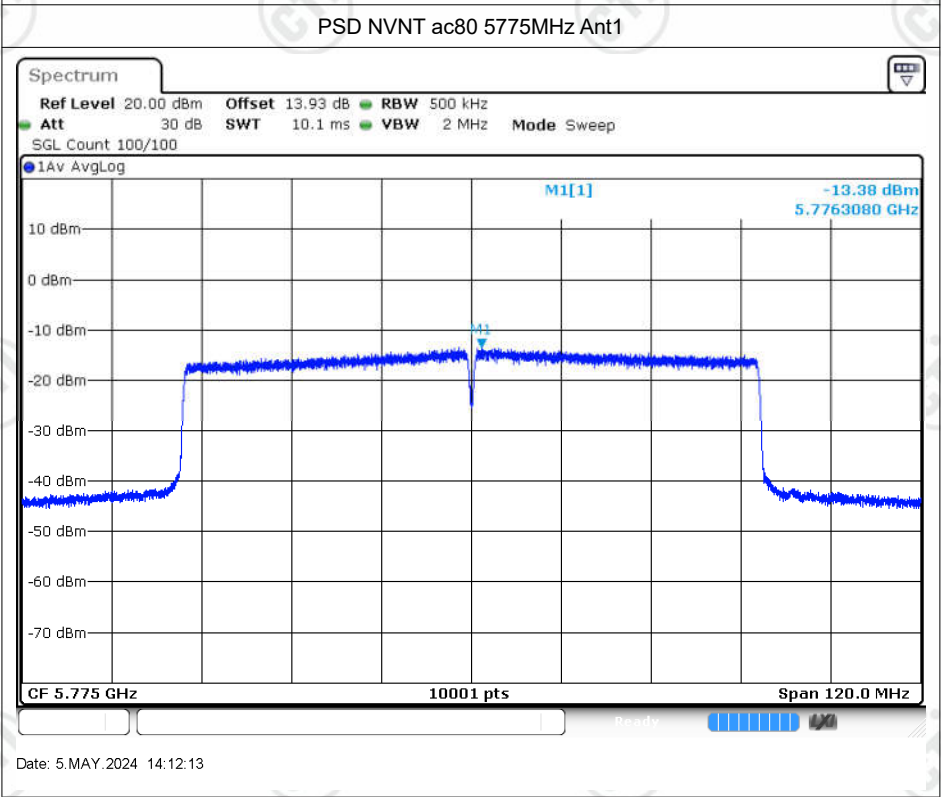

Date: 5.MAY.2024 14:12:13

## Frequency Stability

| Condition | Mode | Frequency<br>(MHz) | Antenna | Measured Frequency<br>(MHz) | Frequency Error<br>(Hz) | Deviation<br>(ppm) | Limit<br>(ppm) | Verdict |
|-----------|------|--------------------|---------|-----------------------------|-------------------------|--------------------|----------------|---------|
| 20C 10.2V | a    | 5180               | Ant1    | 5180.02                     | 20000                   | 3.86               | 25             | Pass    |
| 20C 12V   | a    | 5180               | Ant1    | 5180.04                     | 40000                   | 7.72               | 25             | Pass    |
| 20C 13.8V | a    | 5180               | Ant1    | 5180                        | 0                       | 0                  | 25             | Pass    |
| -20C 12V  | a    | 5180               | Ant1    | 5180.02                     | 20000                   | 3.86               | 25             | Pass    |
| -10C 12V  | a    | 5180               | Ant1    | 5179.98                     | -20000                  | -3.86              | 25             | Pass    |
| 0C 12V    | a    | 5180               | Ant1    | 5179.98                     | -20000                  | -3.86              | 25             | Pass    |
| 10C 12V   | a    | 5180               | Ant1    | 5180.02                     | 20000                   | 3.86               | 25             | Pass    |
| 30C 12V   | a    | 5180               | Ant1    | 5180.04                     | 40000                   | 7.72               | 25             | Pass    |
| 40C 12V   | a    | 5180               | Ant1    | 5180.02                     | 20000                   | 3.86               | 25             | Pass    |
| 50C 12V   | a    | 5180               | Ant1    | 5180                        | 0                       | 0                  | 25             | Pass    |
| 20C 10.2V | a    | 5240               | Ant1    | 5239.98                     | -20000                  | -3.82              | 25             | Pass    |
| 20C 12V   | a    | 5240               | Ant1    | 5240.02                     | 20000                   | 3.82               | 25             | Pass    |
| 20C 13.8V | a    | 5240               | Ant1    | 5239.96                     | -40000                  | -7.63              | 25             | Pass    |
| -20C 12V  | a    | 5240               | Ant1    | 5240                        | 0                       | 0                  | 25             | Pass    |
| -10C 12V  | a    | 5240               | Ant1    | 5239.98                     | -20000                  | -3.82              | 25             | Pass    |
| 0C 12V    | a    | 5240               | Ant1    | 5240.02                     | 20000                   | 3.82               | 25             | Pass    |
| 10C 12V   | a    | 5240               | Ant1    | 5240                        | 0                       | 0                  | 25             | Pass    |
| 30C 12V   | a    | 5240               | Ant1    | 5239.98                     | -20000                  | -3.82              | 25             | Pass    |
| 40C 12V   | a    | 5240               | Ant1    | 5240                        | 0                       | 0                  | 25             | Pass    |
| 50C 12V   | a    | 5240               | Ant1    | 5240                        | 0                       | 0                  | 25             | Pass    |
| 20C 10.2V | a    | 5260               | Ant1    | 5260.02                     | 20000                   | 3.8                | 25             | Pass    |
| 20C 12V   | a    | 5260               | Ant1    | 5260                        | 0                       | 0                  | 25             | Pass    |
| 20C 13.8V | a    | 5260               | Ant1    | 5259.98                     | -20000                  | -3.8               | 25             | Pass    |
| -20C 12V  | a    | 5260               | Ant1    | 5259.98                     | -20000                  | -3.8               | 25             | Pass    |
| -10C 12V  | a    | 5260               | Ant1    | 5259.98                     | -20000                  | -3.8               | 25             | Pass    |
| 0C 12V    | a    | 5260               | Ant1    | 5259.98                     | -20000                  | -3.8               | 25             | Pass    |
| 10C 12V   | a    | 5260               | Ant1    | 5260.02                     | 20000                   | 3.8                | 25             | Pass    |
| 30C 12V   | a    | 5260               | Ant1    | 5259.96                     | -40000                  | -7.6               | 25             | Pass    |
| 40C 12V   | a    | 5260               | Ant1    | 5260                        | 0                       | 0                  | 25             | Pass    |
| 50C 12V   | a    | 5260               | Ant1    | 5259.98                     | -20000                  | -3.8               | 25             | Pass    |
| 20C 10.2V | a    | 5280               | Ant1    | 5280.02                     | 20000                   | 3.79               | 25             | Pass    |
| 20C 12V   | a    | 5280               | Ant1    | 5280                        | 0                       | 0                  | 25             | Pass    |
| 20C 13.8V | a    | 5280               | Ant1    | 5280                        | 0                       | 0                  | 25             | Pass    |
| -20C 12V  | a    | 5280               | Ant1    | 5279.98                     | -20000                  | -3.79              | 25             | Pass    |
| -10C 12V  | a    | 5280               | Ant1    | 5279.98                     | -20000                  | -3.79              | 25             | Pass    |
| 0C 12V    | a    | 5280               | Ant1    | 5279.98                     | -20000                  | -3.79              | 25             | Pass    |
| 10C 12V   | a    | 5280               | Ant1    | 5280.02                     | 20000                   | 3.79               | 25             | Pass    |

|           |   |      |      |         |        |       |    |      |
|-----------|---|------|------|---------|--------|-------|----|------|
| 30C 12V   | a | 5280 | Ant1 | 5279.98 | -20000 | -3.79 | 25 | Pass |
| 40C 12V   | a | 5280 | Ant1 | 5279.98 | -20000 | -3.79 | 25 | Pass |
| 50C 12V   | a | 5280 | Ant1 | 5280.02 | 20000  | 3.79  | 25 | Pass |
| 20C 10.2V | a | 5320 | Ant1 | 5319.96 | -40000 | -7.52 | 25 | Pass |
| 20C 12V   | a | 5320 | Ant1 | 5319.96 | -40000 | -7.52 | 25 | Pass |
| 20C 13.8V | a | 5320 | Ant1 | 5319.98 | -20000 | -3.76 | 25 | Pass |
| -20C 12V  | a | 5320 | Ant1 | 5320.02 | 20000  | 3.76  | 25 | Pass |
| -10C 12V  | a | 5320 | Ant1 | 5320    | 0      | 0     | 25 | Pass |
| 0C 12V    | a | 5320 | Ant1 | 5319.98 | -20000 | -3.76 | 25 | Pass |
| 10C 12V   | a | 5320 | Ant1 | 5320    | 0      | 0     | 25 | Pass |
| 30C 12V   | a | 5320 | Ant1 | 5320    | 0      | 0     | 25 | Pass |
| 40C 12V   | a | 5320 | Ant1 | 5320    | 0      | 0     | 25 | Pass |
| 50C 12V   | a | 5320 | Ant1 | 5319.98 | -20000 | -3.76 | 25 | Pass |
| 20C 10.2V | a | 5500 | Ant1 | 5499.96 | -40000 | -7.27 | 25 | Pass |
| 20C 12V   | a | 5500 | Ant1 | 5500.02 | 20000  | 3.64  | 25 | Pass |
| 20C 13.8V | a | 5500 | Ant1 | 5500    | 0      | 0     | 25 | Pass |
| -20C 12V  | a | 5500 | Ant1 | 5499.98 | -20000 | -3.64 | 25 | Pass |
| -10C 12V  | a | 5500 | Ant1 | 5499.98 | -20000 | -3.64 | 25 | Pass |
| 0C 12V    | a | 5500 | Ant1 | 5499.98 | -20000 | -3.64 | 25 | Pass |
| 10C 12V   | a | 5500 | Ant1 | 5499.96 | -40000 | -7.27 | 25 | Pass |
| 30C 12V   | a | 5500 | Ant1 | 5499.98 | -20000 | -3.64 | 25 | Pass |
| 40C 12V   | a | 5500 | Ant1 | 5500    | 0      | 0     | 25 | Pass |
| 50C 12V   | a | 5500 | Ant1 | 5500.02 | 20000  | 3.64  | 25 | Pass |
| 20C 10.2V | a | 5580 | Ant1 | 5580.02 | 20000  | 3.58  | 25 | Pass |
| 20C 12V   | a | 5580 | Ant1 | 5580    | 0      | 0     | 25 | Pass |
| 20C 13.8V | a | 5580 | Ant1 | 5580.02 | 20000  | 3.58  | 25 | Pass |
| -20C 12V  | a | 5580 | Ant1 | 5579.98 | -20000 | -3.58 | 25 | Pass |
| -10C 12V  | a | 5580 | Ant1 | 5580    | 0      | 0     | 25 | Pass |
| 0C 12V    | a | 5580 | Ant1 | 5580.02 | 20000  | 3.58  | 25 | Pass |
| 10C 12V   | a | 5580 | Ant1 | 5580    | 0      | 0     | 25 | Pass |
| 30C 12V   | a | 5580 | Ant1 | 5580.02 | 20000  | 3.58  | 25 | Pass |
| 40C 12V   | a | 5580 | Ant1 | 5579.98 | -20000 | -3.58 | 25 | Pass |
| 50C 12V   | a | 5580 | Ant1 | 5580    | 0      | 0     | 25 | Pass |
| 20C 10.2V | a | 5700 | Ant1 | 5700    | 0      | 0     | 25 | Pass |
| 20C 12V   | a | 5700 | Ant1 | 5699.98 | -20000 | -3.51 | 25 | Pass |
| 20C 13.8V | a | 5700 | Ant1 | 5700.04 | 40000  | 7.02  | 25 | Pass |
| -20C 12V  | a | 5700 | Ant1 | 5699.98 | -20000 | -3.51 | 25 | Pass |
| -10C 12V  | a | 5700 | Ant1 | 5699.96 | -40000 | -7.02 | 25 | Pass |
| 0C 12V    | a | 5700 | Ant1 | 5700.02 | 20000  | 3.51  | 25 | Pass |
| 10C 12V   | a | 5700 | Ant1 | 5700.02 | 20000  | 3.51  | 25 | Pass |
| 30C 12V   | a | 5700 | Ant1 | 5700.02 | 20000  | 3.51  | 25 | Pass |

|           |     |      |      |         |        |       |    |      |
|-----------|-----|------|------|---------|--------|-------|----|------|
| 40C 12V   | a   | 5700 | Ant1 | 5700.02 | 20000  | 3.51  | 25 | Pass |
| 50C 12V   | a   | 5700 | Ant1 | 5700    | 0      | 0     | 25 | Pass |
| 20C 10.2V | a   | 5745 | Ant1 | 5745    | 0      | 0     | 25 | Pass |
| 20C 12V   | a   | 5745 | Ant1 | 5745    | 0      | 0     | 25 | Pass |
| 20C 13.8V | a   | 5745 | Ant1 | 5745    | 0      | 0     | 25 | Pass |
| -20C 12V  | a   | 5745 | Ant1 | 5745.02 | 20000  | 3.48  | 25 | Pass |
| -10C 12V  | a   | 5745 | Ant1 | 5745    | 0      | 0     | 25 | Pass |
| 0C 12V    | a   | 5745 | Ant1 | 5744.98 | -20000 | -3.48 | 25 | Pass |
| 10C 12V   | a   | 5745 | Ant1 | 5745    | 0      | 0     | 25 | Pass |
| 30C 12V   | a   | 5745 | Ant1 | 5745    | 0      | 0     | 25 | Pass |
| 40C 12V   | a   | 5745 | Ant1 | 5745    | 0      | 0     | 25 | Pass |
| 50C 12V   | a   | 5745 | Ant1 | 5744.98 | -20000 | -3.48 | 25 | Pass |
| 20C 10.2V | a   | 5825 | Ant1 | 5825    | 0      | 0     | 25 | Pass |
| 20C 12V   | a   | 5825 | Ant1 | 5825.02 | 20000  | 3.43  | 25 | Pass |
| 20C 13.8V | a   | 5825 | Ant1 | 5825.02 | 20000  | 3.43  | 25 | Pass |
| -20C 12V  | a   | 5825 | Ant1 | 5825.02 | 20000  | 3.43  | 25 | Pass |
| -10C 12V  | a   | 5825 | Ant1 | 5824.98 | -20000 | -3.43 | 25 | Pass |
| 0C 12V    | a   | 5825 | Ant1 | 5825.02 | 20000  | 3.43  | 25 | Pass |
| 10C 12V   | a   | 5825 | Ant1 | 5825.02 | 20000  | 3.43  | 25 | Pass |
| 30C 12V   | a   | 5825 | Ant1 | 5824.96 | -40000 | -6.87 | 25 | Pass |
| 40C 12V   | a   | 5825 | Ant1 | 5825.02 | 20000  | 3.43  | 25 | Pass |
| 50C 12V   | a   | 5825 | Ant1 | 5825    | 0      | 0     | 25 | Pass |
| 20C 10.2V | n20 | 5180 | Ant1 | 5180.02 | 20000  | 3.86  | 25 | Pass |
| 20C 12V   | n20 | 5180 | Ant1 | 5179.98 | -20000 | -3.86 | 25 | Pass |
| 20C 13.8V | n20 | 5180 | Ant1 | 5179.98 | -20000 | -3.86 | 25 | Pass |
| -20C 12V  | n20 | 5180 | Ant1 | 5180    | 0      | 0     | 25 | Pass |
| -10C 12V  | n20 | 5180 | Ant1 | 5180    | 0      | 0     | 25 | Pass |
| 0C 12V    | n20 | 5180 | Ant1 | 5179.98 | -20000 | -3.86 | 25 | Pass |
| 10C 12V   | n20 | 5180 | Ant1 | 5180.02 | 20000  | 3.86  | 25 | Pass |
| 30C 12V   | n20 | 5180 | Ant1 | 5180    | 0      | 0     | 25 | Pass |
| 40C 12V   | n20 | 5180 | Ant1 | 5180    | 0      | 0     | 25 | Pass |
| 50C 12V   | n20 | 5180 | Ant1 | 5180    | 0      | 0     | 25 | Pass |
| 20C 10.2V | n20 | 5240 | Ant1 | 5239.96 | -40000 | -7.63 | 25 | Pass |
| 20C 12V   | n20 | 5240 | Ant1 | 5239.98 | -20000 | -3.82 | 25 | Pass |
| 20C 13.8V | n20 | 5240 | Ant1 | 5239.98 | -20000 | -3.82 | 25 | Pass |
| -20C 12V  | n20 | 5240 | Ant1 | 5239.98 | -20000 | -3.82 | 25 | Pass |
| -10C 12V  | n20 | 5240 | Ant1 | 5240    | 0      | 0     | 25 | Pass |
| 0C 12V    | n20 | 5240 | Ant1 | 5239.98 | -20000 | -3.82 | 25 | Pass |
| 10C 12V   | n20 | 5240 | Ant1 | 5239.96 | -40000 | -7.63 | 25 | Pass |
| 30C 12V   | n20 | 5240 | Ant1 | 5239.98 | -20000 | -3.82 | 25 | Pass |
| 40C 12V   | n20 | 5240 | Ant1 | 5239.98 | -20000 | -3.82 | 25 | Pass |

|           |     |      |      |         |        |        |    |      |
|-----------|-----|------|------|---------|--------|--------|----|------|
| 50C 12V   | n20 | 5240 | Ant1 | 5239.98 | -20000 | -3.82  | 25 | Pass |
| 20C 10.2V | n20 | 5260 | Ant1 | 5259.98 | -20000 | -3.8   | 25 | Pass |
| 20C 12V   | n20 | 5260 | Ant1 | 5260    | 0      | 0      | 25 | Pass |
| 20C 13.8V | n20 | 5260 | Ant1 | 5259.98 | -20000 | -3.8   | 25 | Pass |
| -20C 12V  | n20 | 5260 | Ant1 | 5260.02 | 20000  | 3.8    | 25 | Pass |
| -10C 12V  | n20 | 5260 | Ant1 | 5259.98 | -20000 | -3.8   | 25 | Pass |
| 0C 12V    | n20 | 5260 | Ant1 | 5259.96 | -40000 | -7.6   | 25 | Pass |
| 10C 12V   | n20 | 5260 | Ant1 | 5259.98 | -20000 | -3.8   | 25 | Pass |
| 30C 12V   | n20 | 5260 | Ant1 | 5260.02 | 20000  | 3.8    | 25 | Pass |
| 40C 12V   | n20 | 5260 | Ant1 | 5259.98 | -20000 | -3.8   | 25 | Pass |
| 50C 12V   | n20 | 5260 | Ant1 | 5260.02 | 20000  | 3.8    | 25 | Pass |
| 20C 10.2V | n20 | 5280 | Ant1 | 5280    | 0      | 0      | 25 | Pass |
| 20C 12V   | n20 | 5280 | Ant1 | 5280    | 0      | 0      | 25 | Pass |
| 20C 13.8V | n20 | 5280 | Ant1 | 5279.96 | -40000 | -7.58  | 25 | Pass |
| -20C 12V  | n20 | 5280 | Ant1 | 5280    | 0      | 0      | 25 | Pass |
| -10C 12V  | n20 | 5280 | Ant1 | 5279.98 | -20000 | -3.79  | 25 | Pass |
| 0C 12V    | n20 | 5280 | Ant1 | 5279.98 | -20000 | -3.79  | 25 | Pass |
| 10C 12V   | n20 | 5280 | Ant1 | 5279.98 | -20000 | -3.79  | 25 | Pass |
| 30C 12V   | n20 | 5280 | Ant1 | 5280    | 0      | 0      | 25 | Pass |
| 40C 12V   | n20 | 5280 | Ant1 | 5280    | 0      | 0      | 25 | Pass |
| 50C 12V   | n20 | 5280 | Ant1 | 5280.02 | 20000  | 3.79   | 25 | Pass |
| 20C 10.2V | n20 | 5320 | Ant1 | 5320    | 0      | 0      | 25 | Pass |
| 20C 12V   | n20 | 5320 | Ant1 | 5320.02 | 20000  | 3.76   | 25 | Pass |
| 20C 13.8V | n20 | 5320 | Ant1 | 5320    | 0      | 0      | 25 | Pass |
| -20C 12V  | n20 | 5320 | Ant1 | 5320    | 0      | 0      | 25 | Pass |
| -10C 12V  | n20 | 5320 | Ant1 | 5320    | 0      | 0      | 25 | Pass |
| 0C 12V    | n20 | 5320 | Ant1 | 5319.98 | -20000 | -3.76  | 25 | Pass |
| 10C 12V   | n20 | 5320 | Ant1 | 5320    | 0      | 0      | 25 | Pass |
| 30C 12V   | n20 | 5320 | Ant1 | 5319.98 | -20000 | -3.76  | 25 | Pass |
| 40C 12V   | n20 | 5320 | Ant1 | 5320    | 0      | 0      | 25 | Pass |
| 50C 12V   | n20 | 5320 | Ant1 | 5319.94 | -60000 | -11.28 | 25 | Pass |
| 20C 10.2V | n20 | 5500 | Ant1 | 5499.98 | -20000 | -3.64  | 25 | Pass |
| 20C 12V   | n20 | 5500 | Ant1 | 5499.98 | -20000 | -3.64  | 25 | Pass |
| 20C 13.8V | n20 | 5500 | Ant1 | 5500    | 0      | 0      | 25 | Pass |
| -20C 12V  | n20 | 5500 | Ant1 | 5499.96 | -40000 | -7.27  | 25 | Pass |
| -10C 12V  | n20 | 5500 | Ant1 | 5500.02 | 20000  | 3.64   | 25 | Pass |
| 0C 12V    | n20 | 5500 | Ant1 | 5499.96 | -40000 | -7.27  | 25 | Pass |
| 10C 12V   | n20 | 5500 | Ant1 | 5499.98 | -20000 | -3.64  | 25 | Pass |
| 30C 12V   | n20 | 5500 | Ant1 | 5499.96 | -40000 | -7.27  | 25 | Pass |
| 40C 12V   | n20 | 5500 | Ant1 | 5499.98 | -20000 | -3.64  | 25 | Pass |
| 50C 12V   | n20 | 5500 | Ant1 | 5500    | 0      | 0      | 25 | Pass |

|           |     |      |      |         |        |       |    |      |
|-----------|-----|------|------|---------|--------|-------|----|------|
| 20C 10.2V | n20 | 5580 | Ant1 | 5580    | 0      | 0     | 25 | Pass |
| 20C 12V   | n20 | 5580 | Ant1 | 5580    | 0      | 0     | 25 | Pass |
| 20C 13.8V | n20 | 5580 | Ant1 | 5580.02 | 20000  | 3.58  | 25 | Pass |
| -20C 12V  | n20 | 5580 | Ant1 | 5579.98 | -20000 | -3.58 | 25 | Pass |
| -10C 12V  | n20 | 5580 | Ant1 | 5580    | 0      | 0     | 25 | Pass |
| 0C 12V    | n20 | 5580 | Ant1 | 5579.98 | -20000 | -3.58 | 25 | Pass |
| 10C 12V   | n20 | 5580 | Ant1 | 5580    | 0      | 0     | 25 | Pass |
| 30C 12V   | n20 | 5580 | Ant1 | 5580    | 0      | 0     | 25 | Pass |
| 40C 12V   | n20 | 5580 | Ant1 | 5580    | 0      | 0     | 25 | Pass |
| 50C 12V   | n20 | 5580 | Ant1 | 5580    | 0      | 0     | 25 | Pass |
| 20C 10.2V | n20 | 5700 | Ant1 | 5700    | 0      | 0     | 25 | Pass |
| 20C 12V   | n20 | 5700 | Ant1 | 5700.02 | 20000  | 3.51  | 25 | Pass |
| 20C 13.8V | n20 | 5700 | Ant1 | 5700.02 | 20000  | 3.51  | 25 | Pass |
| -20C 12V  | n20 | 5700 | Ant1 | 5699.98 | -20000 | -3.51 | 25 | Pass |
| -10C 12V  | n20 | 5700 | Ant1 | 5700.04 | 40000  | 7.02  | 25 | Pass |
| 0C 12V    | n20 | 5700 | Ant1 | 5700    | 0      | 0     | 25 | Pass |
| 10C 12V   | n20 | 5700 | Ant1 | 5700    | 0      | 0     | 25 | Pass |
| 30C 12V   | n20 | 5700 | Ant1 | 5699.98 | -20000 | -3.51 | 25 | Pass |
| 40C 12V   | n20 | 5700 | Ant1 | 5700    | 0      | 0     | 25 | Pass |
| 50C 12V   | n20 | 5700 | Ant1 | 5700    | 0      | 0     | 25 | Pass |
| 20C 10.2V | n20 | 5745 | Ant1 | 5745.02 | 20000  | 3.48  | 25 | Pass |
| 20C 12V   | n20 | 5745 | Ant1 | 5745    | 0      | 0     | 25 | Pass |
| 20C 13.8V | n20 | 5745 | Ant1 | 5745.02 | 20000  | 3.48  | 25 | Pass |
| -20C 12V  | n20 | 5745 | Ant1 | 5744.98 | -20000 | -3.48 | 25 | Pass |
| -10C 12V  | n20 | 5745 | Ant1 | 5745    | 0      | 0     | 25 | Pass |
| 0C 12V    | n20 | 5745 | Ant1 | 5744.98 | -20000 | -3.48 | 25 | Pass |
| 10C 12V   | n20 | 5745 | Ant1 | 5745.02 | 20000  | 3.48  | 25 | Pass |
| 30C 12V   | n20 | 5745 | Ant1 | 5745.02 | 20000  | 3.48  | 25 | Pass |
| 40C 12V   | n20 | 5745 | Ant1 | 5745    | 0      | 0     | 25 | Pass |
| 50C 12V   | n20 | 5745 | Ant1 | 5745.02 | 20000  | 3.48  | 25 | Pass |
| 20C 10.2V | n20 | 5825 | Ant1 | 5825    | 0      | 0     | 25 | Pass |
| 20C 12V   | n20 | 5825 | Ant1 | 5825    | 0      | 0     | 25 | Pass |
| 20C 13.8V | n20 | 5825 | Ant1 | 5824.98 | -20000 | -3.43 | 25 | Pass |
| -20C 12V  | n20 | 5825 | Ant1 | 5825    | 0      | 0     | 25 | Pass |
| -10C 12V  | n20 | 5825 | Ant1 | 5825    | 0      | 0     | 25 | Pass |
| 0C 12V    | n20 | 5825 | Ant1 | 5824.98 | -20000 | -3.43 | 25 | Pass |
| 10C 12V   | n20 | 5825 | Ant1 | 5825    | 0      | 0     | 25 | Pass |
| 30C 12V   | n20 | 5825 | Ant1 | 5825.02 | 20000  | 3.43  | 25 | Pass |
| 40C 12V   | n20 | 5825 | Ant1 | 5825    | 0      | 0     | 25 | Pass |
| 50C 12V   | n20 | 5825 | Ant1 | 5825    | 0      | 0     | 25 | Pass |
| 20C 10.2V | n40 | 5190 | Ant1 | 5190    | 0      | 0     | 25 | Pass |

|           |     |      |      |         |        |       |    |      |
|-----------|-----|------|------|---------|--------|-------|----|------|
| 20C 12V   | n40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71 | 25 | Pass |
| 20C 13.8V | n40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71 | 25 | Pass |
| -20C 12V  | n40 | 5190 | Ant1 | 5190    | 0      | 0     | 25 | Pass |
| -10C 12V  | n40 | 5190 | Ant1 | 5190    | 0      | 0     | 25 | Pass |
| 0C 12V    | n40 | 5190 | Ant1 | 5190    | 0      | 0     | 25 | Pass |
| 10C 12V   | n40 | 5190 | Ant1 | 5190    | 0      | 0     | 25 | Pass |
| 30C 12V   | n40 | 5190 | Ant1 | 5190    | 0      | 0     | 25 | Pass |
| 40C 12V   | n40 | 5190 | Ant1 | 5190    | 0      | 0     | 25 | Pass |
| 50C 12V   | n40 | 5190 | Ant1 | 5190    | 0      | 0     | 25 | Pass |
| 20C 10.2V | n40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65 | 25 | Pass |
| 20C 12V   | n40 | 5230 | Ant1 | 5230    | 0      | 0     | 25 | Pass |
| 20C 13.8V | n40 | 5230 | Ant1 | 5230    | 0      | 0     | 25 | Pass |
| -20C 12V  | n40 | 5230 | Ant1 | 5230    | 0      | 0     | 25 | Pass |
| -10C 12V  | n40 | 5230 | Ant1 | 5230    | 0      | 0     | 25 | Pass |
| 0C 12V    | n40 | 5230 | Ant1 | 5230    | 0      | 0     | 25 | Pass |
| 10C 12V   | n40 | 5230 | Ant1 | 5230    | 0      | 0     | 25 | Pass |
| 30C 12V   | n40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65 | 25 | Pass |
| 40C 12V   | n40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65 | 25 | Pass |
| 50C 12V   | n40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65 | 25 | Pass |
| 20C 10.2V | n40 | 5270 | Ant1 | 5270    | 0      | 0     | 25 | Pass |
| 20C 12V   | n40 | 5270 | Ant1 | 5270    | 0      | 0     | 25 | Pass |
| 20C 13.8V | n40 | 5270 | Ant1 | 5270    | 0      | 0     | 25 | Pass |
| -20C 12V  | n40 | 5270 | Ant1 | 5269.96 | -40000 | -7.59 | 25 | Pass |
| -10C 12V  | n40 | 5270 | Ant1 | 5269.96 | -40000 | -7.59 | 25 | Pass |
| 0C 12V    | n40 | 5270 | Ant1 | 5270    | 0      | 0     | 25 | Pass |
| 10C 12V   | n40 | 5270 | Ant1 | 5270    | 0      | 0     | 25 | Pass |
| 30C 12V   | n40 | 5270 | Ant1 | 5270    | 0      | 0     | 25 | Pass |
| 40C 12V   | n40 | 5270 | Ant1 | 5269.96 | -40000 | -7.59 | 25 | Pass |
| 50C 12V   | n40 | 5270 | Ant1 | 5270    | 0      | 0     | 25 | Pass |
| 20C 10.2V | n40 | 5310 | Ant1 | 5310    | 0      | 0     | 25 | Pass |
| 20C 12V   | n40 | 5310 | Ant1 | 5310    | 0      | 0     | 25 | Pass |
| 20C 13.8V | n40 | 5310 | Ant1 | 5310    | 0      | 0     | 25 | Pass |
| -20C 12V  | n40 | 5310 | Ant1 | 5310    | 0      | 0     | 25 | Pass |
| -10C 12V  | n40 | 5310 | Ant1 | 5309.96 | -40000 | -7.53 | 25 | Pass |
| 0C 12V    | n40 | 5310 | Ant1 | 5309.96 | -40000 | -7.53 | 25 | Pass |
| 10C 12V   | n40 | 5310 | Ant1 | 5310    | 0      | 0     | 25 | Pass |
| 30C 12V   | n40 | 5310 | Ant1 | 5310    | 0      | 0     | 25 | Pass |
| 40C 12V   | n40 | 5310 | Ant1 | 5310    | 0      | 0     | 25 | Pass |
| 50C 12V   | n40 | 5310 | Ant1 | 5310    | 0      | 0     | 25 | Pass |
| 20C 10.2V | n40 | 5510 | Ant1 | 5509.96 | -40000 | -7.26 | 25 | Pass |
| 20C 12V   | n40 | 5510 | Ant1 | 5509.96 | -40000 | -7.26 | 25 | Pass |

|           |     |      |      |         |         |        |    |      |
|-----------|-----|------|------|---------|---------|--------|----|------|
| 20C 13.8V | n40 | 5510 | Ant1 | 5510    | 0       | 0      | 25 | Pass |
| -20C 12V  | n40 | 5510 | Ant1 | 5510    | 0       | 0      | 25 | Pass |
| -10C 12V  | n40 | 5510 | Ant1 | 5509.96 | -40000  | -7.26  | 25 | Pass |
| 0C 12V    | n40 | 5510 | Ant1 | 5510    | 0       | 0      | 25 | Pass |
| 10C 12V   | n40 | 5510 | Ant1 | 5510    | 0       | 0      | 25 | Pass |
| 30C 12V   | n40 | 5510 | Ant1 | 5510    | 0       | 0      | 25 | Pass |
| 40C 12V   | n40 | 5510 | Ant1 | 5510    | 0       | 0      | 25 | Pass |
| 50C 12V   | n40 | 5510 | Ant1 | 5510    | 0       | 0      | 25 | Pass |
| 20C 10.2V | n40 | 5550 | Ant1 | 5549.84 | -160000 | -28.83 | 25 | Pass |
| 20C 12V   | n40 | 5550 | Ant1 | 5549.96 | -40000  | -7.21  | 25 | Pass |
| 20C 13.8V | n40 | 5550 | Ant1 | 5550    | 0       | 0      | 25 | Pass |
| -20C 12V  | n40 | 5550 | Ant1 | 5549.96 | -40000  | -7.21  | 25 | Pass |
| -10C 12V  | n40 | 5550 | Ant1 | 5550    | 0       | 0      | 25 | Pass |
| 0C 12V    | n40 | 5550 | Ant1 | 5549.96 | -40000  | -7.21  | 25 | Pass |
| 10C 12V   | n40 | 5550 | Ant1 | 5549.96 | -40000  | -7.21  | 25 | Pass |
| 30C 12V   | n40 | 5550 | Ant1 | 5550    | 0       | 0      | 25 | Pass |
| 40C 12V   | n40 | 5550 | Ant1 | 5550    | 0       | 0      | 25 | Pass |
| 50C 12V   | n40 | 5550 | Ant1 | 5550    | 0       | 0      | 25 | Pass |
| 20C 10.2V | n40 | 5670 | Ant1 | 5670.04 | 40000   | 7.05   | 25 | Pass |
| 20C 12V   | n40 | 5670 | Ant1 | 5670    | 0       | 0      | 25 | Pass |
| 20C 13.8V | n40 | 5670 | Ant1 | 5670    | 0       | 0      | 25 | Pass |
| -20C 12V  | n40 | 5670 | Ant1 | 5670    | 0       | 0      | 25 | Pass |
| -10C 12V  | n40 | 5670 | Ant1 | 5670    | 0       | 0      | 25 | Pass |
| 0C 12V    | n40 | 5670 | Ant1 | 5669.96 | -40000  | -7.05  | 25 | Pass |
| 10C 12V   | n40 | 5670 | Ant1 | 5670    | 0       | 0      | 25 | Pass |
| 30C 12V   | n40 | 5670 | Ant1 | 5670    | 0       | 0      | 25 | Pass |
| 40C 12V   | n40 | 5670 | Ant1 | 5670    | 0       | 0      | 25 | Pass |
| 50C 12V   | n40 | 5670 | Ant1 | 5670.04 | 40000   | 7.05   | 25 | Pass |
| 20C 10.2V | n40 | 5755 | Ant1 | 5755.04 | 40000   | 6.95   | 25 | Pass |
| 20C 12V   | n40 | 5755 | Ant1 | 5755    | 0       | 0      | 25 | Pass |
| 20C 13.8V | n40 | 5755 | Ant1 | 5755    | 0       | 0      | 25 | Pass |
| -20C 12V  | n40 | 5755 | Ant1 | 5755    | 0       | 0      | 25 | Pass |
| -10C 12V  | n40 | 5755 | Ant1 | 5755    | 0       | 0      | 25 | Pass |
| 0C 12V    | n40 | 5755 | Ant1 | 5755    | 0       | 0      | 25 | Pass |
| 10C 12V   | n40 | 5755 | Ant1 | 5755    | 0       | 0      | 25 | Pass |
| 30C 12V   | n40 | 5755 | Ant1 | 5755    | 0       | 0      | 25 | Pass |
| 40C 12V   | n40 | 5755 | Ant1 | 5755    | 0       | 0      | 25 | Pass |
| 50C 12V   | n40 | 5755 | Ant1 | 5755.04 | 40000   | 6.95   | 25 | Pass |
| 20C 10.2V | n40 | 5795 | Ant1 | 5795.04 | 40000   | 6.9    | 25 | Pass |
| 20C 12V   | n40 | 5795 | Ant1 | 5795.04 | 40000   | 6.9    | 25 | Pass |
| 20C 13.8V | n40 | 5795 | Ant1 | 5795    | 0       | 0      | 25 | Pass |

|           |      |      |      |         |        |       |    |      |
|-----------|------|------|------|---------|--------|-------|----|------|
| -20C 12V  | n40  | 5795 | Ant1 | 5795    | 0      | 0     | 25 | Pass |
| -10C 12V  | n40  | 5795 | Ant1 | 5795.2  | 200000 | 34.51 | 25 | Pass |
| 0C 12V    | n40  | 5795 | Ant1 | 5795    | 0      | 0     | 25 | Pass |
| 10C 12V   | n40  | 5795 | Ant1 | 5795.04 | 40000  | 6.9   | 25 | Pass |
| 30C 12V   | n40  | 5795 | Ant1 | 5795    | 0      | 0     | 25 | Pass |
| 40C 12V   | n40  | 5795 | Ant1 | 5795    | 0      | 0     | 25 | Pass |
| 50C 12V   | n40  | 5795 | Ant1 | 5795.04 | 40000  | 6.9   | 25 | Pass |
| 20C 10.2V | ac20 | 5180 | Ant1 | 5180    | 0      | 0     | 25 | Pass |
| 20C 12V   | ac20 | 5180 | Ant1 | 5179.98 | -20000 | -3.86 | 25 | Pass |
| 20C 13.8V | ac20 | 5180 | Ant1 | 5180    | 0      | 0     | 25 | Pass |
| -20C 12V  | ac20 | 5180 | Ant1 | 5180    | 0      | 0     | 25 | Pass |
| -10C 12V  | ac20 | 5180 | Ant1 | 5180.02 | 20000  | 3.86  | 25 | Pass |
| 0C 12V    | ac20 | 5180 | Ant1 | 5180    | 0      | 0     | 25 | Pass |
| 10C 12V   | ac20 | 5180 | Ant1 | 5180    | 0      | 0     | 25 | Pass |
| 30C 12V   | ac20 | 5180 | Ant1 | 5179.98 | -20000 | -3.86 | 25 | Pass |
| 40C 12V   | ac20 | 5180 | Ant1 | 5179.98 | -20000 | -3.86 | 25 | Pass |
| 50C 12V   | ac20 | 5180 | Ant1 | 5179.98 | -20000 | -3.86 | 25 | Pass |
| 20C 10.2V | ac20 | 5240 | Ant1 | 5239.98 | -20000 | -3.82 | 25 | Pass |
| 20C 12V   | ac20 | 5240 | Ant1 | 5239.98 | -20000 | -3.82 | 25 | Pass |
| 20C 13.8V | ac20 | 5240 | Ant1 | 5239.98 | -20000 | -3.82 | 25 | Pass |
| -20C 12V  | ac20 | 5240 | Ant1 | 5240    | 0      | 0     | 25 | Pass |
| -10C 12V  | ac20 | 5240 | Ant1 | 5239.98 | -20000 | -3.82 | 25 | Pass |
| 0C 12V    | ac20 | 5240 | Ant1 | 5240    | 0      | 0     | 25 | Pass |
| 10C 12V   | ac20 | 5240 | Ant1 | 5240.02 | 20000  | 3.82  | 25 | Pass |
| 30C 12V   | ac20 | 5240 | Ant1 | 5240.02 | 20000  | 3.82  | 25 | Pass |
| 40C 12V   | ac20 | 5240 | Ant1 | 5240    | 0      | 0     | 25 | Pass |
| 50C 12V   | ac20 | 5240 | Ant1 | 5240    | 0      | 0     | 25 | Pass |
| 20C 10.2V | ac20 | 5260 | Ant1 | 5259.98 | -20000 | -3.8  | 25 | Pass |
| 20C 12V   | ac20 | 5260 | Ant1 | 5260    | 0      | 0     | 25 | Pass |
| 20C 13.8V | ac20 | 5260 | Ant1 | 5259.98 | -20000 | -3.8  | 25 | Pass |
| -20C 12V  | ac20 | 5260 | Ant1 | 5260    | 0      | 0     | 25 | Pass |
| -10C 12V  | ac20 | 5260 | Ant1 | 5259.98 | -20000 | -3.8  | 25 | Pass |
| 0C 12V    | ac20 | 5260 | Ant1 | 5260    | 0      | 0     | 25 | Pass |
| 10C 12V   | ac20 | 5260 | Ant1 | 5259.98 | -20000 | -3.8  | 25 | Pass |
| 30C 12V   | ac20 | 5260 | Ant1 | 5260.02 | 20000  | 3.8   | 25 | Pass |
| 40C 12V   | ac20 | 5260 | Ant1 | 5259.98 | -20000 | -3.8  | 25 | Pass |
| 50C 12V   | ac20 | 5260 | Ant1 | 5259.98 | -20000 | -3.8  | 25 | Pass |
| 20C 10.2V | ac20 | 5280 | Ant1 | 5280    | 0      | 0     | 25 | Pass |
| 20C 12V   | ac20 | 5280 | Ant1 | 5280    | 0      | 0     | 25 | Pass |
| 20C 13.8V | ac20 | 5280 | Ant1 | 5279.98 | -20000 | -3.79 | 25 | Pass |
| -20C 12V  | ac20 | 5280 | Ant1 | 5280.02 | 20000  | 3.79  | 25 | Pass |

|           |      |      |      |         |        |       |    |      |
|-----------|------|------|------|---------|--------|-------|----|------|
| -10C 12V  | ac20 | 5280 | Ant1 | 5280.02 | 20000  | 3.79  | 25 | Pass |
| 0C 12V    | ac20 | 5280 | Ant1 | 5279.98 | -20000 | -3.79 | 25 | Pass |
| 10C 12V   | ac20 | 5280 | Ant1 | 5280    | 0      | 0     | 25 | Pass |
| 30C 12V   | ac20 | 5280 | Ant1 | 5279.98 | -20000 | -3.79 | 25 | Pass |
| 40C 12V   | ac20 | 5280 | Ant1 | 5279.98 | -20000 | -3.79 | 25 | Pass |
| 50C 12V   | ac20 | 5280 | Ant1 | 5279.98 | -20000 | -3.79 | 25 | Pass |
| 20C 10.2V | ac20 | 5320 | Ant1 | 5320.02 | 20000  | 3.76  | 25 | Pass |
| 20C 12V   | ac20 | 5320 | Ant1 | 5320.02 | 20000  | 3.76  | 25 | Pass |
| 20C 13.8V | ac20 | 5320 | Ant1 | 5320    | 0      | 0     | 25 | Pass |
| -20C 12V  | ac20 | 5320 | Ant1 | 5320    | 0      | 0     | 25 | Pass |
| -10C 12V  | ac20 | 5320 | Ant1 | 5320.02 | 20000  | 3.76  | 25 | Pass |
| 0C 12V    | ac20 | 5320 | Ant1 | 5320    | 0      | 0     | 25 | Pass |
| 10C 12V   | ac20 | 5320 | Ant1 | 5319.98 | -20000 | -3.76 | 25 | Pass |
| 30C 12V   | ac20 | 5320 | Ant1 | 5320    | 0      | 0     | 25 | Pass |
| 40C 12V   | ac20 | 5320 | Ant1 | 5319.98 | -20000 | -3.76 | 25 | Pass |
| 50C 12V   | ac20 | 5320 | Ant1 | 5320    | 0      | 0     | 25 | Pass |
| 20C 10.2V | ac20 | 5500 | Ant1 | 5500    | 0      | 0     | 25 | Pass |
| 20C 12V   | ac20 | 5500 | Ant1 | 5499.98 | -20000 | -3.64 | 25 | Pass |
| 20C 13.8V | ac20 | 5500 | Ant1 | 5499.98 | -20000 | -3.64 | 25 | Pass |
| -20C 12V  | ac20 | 5500 | Ant1 | 5499.98 | -20000 | -3.64 | 25 | Pass |
| -10C 12V  | ac20 | 5500 | Ant1 | 5500    | 0      | 0     | 25 | Pass |
| 0C 12V    | ac20 | 5500 | Ant1 | 5499.96 | -40000 | -7.27 | 25 | Pass |
| 10C 12V   | ac20 | 5500 | Ant1 | 5499.98 | -20000 | -3.64 | 25 | Pass |
| 30C 12V   | ac20 | 5500 | Ant1 | 5499.98 | -20000 | -3.64 | 25 | Pass |
| 40C 12V   | ac20 | 5500 | Ant1 | 5500    | 0      | 0     | 25 | Pass |
| 50C 12V   | ac20 | 5500 | Ant1 | 5500.02 | 20000  | 3.64  | 25 | Pass |
| 20C 10.2V | ac20 | 5580 | Ant1 | 5579.98 | -20000 | -3.58 | 25 | Pass |
| 20C 12V   | ac20 | 5580 | Ant1 | 5580    | 0      | 0     | 25 | Pass |
| 20C 13.8V | ac20 | 5580 | Ant1 | 5580    | 0      | 0     | 25 | Pass |
| -20C 12V  | ac20 | 5580 | Ant1 | 5579.98 | -20000 | -3.58 | 25 | Pass |
| -10C 12V  | ac20 | 5580 | Ant1 | 5579.98 | -20000 | -3.58 | 25 | Pass |
| 0C 12V    | ac20 | 5580 | Ant1 | 5580    | 0      | 0     | 25 | Pass |
| 10C 12V   | ac20 | 5580 | Ant1 | 5580    | 0      | 0     | 25 | Pass |
| 30C 12V   | ac20 | 5580 | Ant1 | 5580.02 | 20000  | 3.58  | 25 | Pass |
| 40C 12V   | ac20 | 5580 | Ant1 | 5580    | 0      | 0     | 25 | Pass |
| 50C 12V   | ac20 | 5580 | Ant1 | 5580    | 0      | 0     | 25 | Pass |
| 20C 10.2V | ac20 | 5700 | Ant1 | 5700    | 0      | 0     | 25 | Pass |
| 20C 12V   | ac20 | 5700 | Ant1 | 5700.02 | 20000  | 3.51  | 25 | Pass |
| 20C 13.8V | ac20 | 5700 | Ant1 | 5699.98 | -20000 | -3.51 | 25 | Pass |
| -20C 12V  | ac20 | 5700 | Ant1 | 5699.98 | -20000 | -3.51 | 25 | Pass |
| -10C 12V  | ac20 | 5700 | Ant1 | 5699.98 | -20000 | -3.51 | 25 | Pass |

|           |      |      |      |         |         |        |    |      |
|-----------|------|------|------|---------|---------|--------|----|------|
| 0C 12V    | ac20 | 5700 | Ant1 | 5700    | 0       | 0      | 25 | Pass |
| 10C 12V   | ac20 | 5700 | Ant1 | 5700    | 0       | 0      | 25 | Pass |
| 30C 12V   | ac20 | 5700 | Ant1 | 5699.98 | -20000  | -3.51  | 25 | Pass |
| 40C 12V   | ac20 | 5700 | Ant1 | 5700    | 0       | 0      | 25 | Pass |
| 50C 12V   | ac20 | 5700 | Ant1 | 5699.98 | -20000  | -3.51  | 25 | Pass |
| 20C 10.2V | ac20 | 5745 | Ant1 | 5745.02 | 20000   | 3.48   | 25 | Pass |
| 20C 12V   | ac20 | 5745 | Ant1 | 5745    | 0       | 0      | 25 | Pass |
| 20C 13.8V | ac20 | 5745 | Ant1 | 5745    | 0       | 0      | 25 | Pass |
| -20C 12V  | ac20 | 5745 | Ant1 | 5745.02 | 20000   | 3.48   | 25 | Pass |
| -10C 12V  | ac20 | 5745 | Ant1 | 5745    | 0       | 0      | 25 | Pass |
| 0C 12V    | ac20 | 5745 | Ant1 | 5745    | 0       | 0      | 25 | Pass |
| 10C 12V   | ac20 | 5745 | Ant1 | 5745.02 | 20000   | 3.48   | 25 | Pass |
| 30C 12V   | ac20 | 5745 | Ant1 | 5745    | 0       | 0      | 25 | Pass |
| 40C 12V   | ac20 | 5745 | Ant1 | 5745.02 | 20000   | 3.48   | 25 | Pass |
| 50C 12V   | ac20 | 5745 | Ant1 | 5745    | 0       | 0      | 25 | Pass |
| 20C 10.2V | ac20 | 5825 | Ant1 | 5824.98 | -20000  | -3.43  | 25 | Pass |
| 20C 12V   | ac20 | 5825 | Ant1 | 5825    | 0       | 0      | 25 | Pass |
| 20C 13.8V | ac20 | 5825 | Ant1 | 5824.96 | -40000  | -6.87  | 25 | Pass |
| -20C 12V  | ac20 | 5825 | Ant1 | 5825    | 0       | 0      | 25 | Pass |
| -10C 12V  | ac20 | 5825 | Ant1 | 5825    | 0       | 0      | 25 | Pass |
| 0C 12V    | ac20 | 5825 | Ant1 | 5825    | 0       | 0      | 25 | Pass |
| 10C 12V   | ac20 | 5825 | Ant1 | 5825.02 | 20000   | 3.43   | 25 | Pass |
| 30C 12V   | ac20 | 5825 | Ant1 | 5824.98 | -20000  | -3.43  | 25 | Pass |
| 40C 12V   | ac20 | 5825 | Ant1 | 5825    | 0       | 0      | 25 | Pass |
| 50C 12V   | ac20 | 5825 | Ant1 | 5825    | 0       | 0      | 25 | Pass |
| 20C 10.2V | ac40 | 5190 | Ant1 | 5190    | 0       | 0      | 25 | Pass |
| 20C 12V   | ac40 | 5190 | Ant1 | 5190    | 0       | 0      | 25 | Pass |
| 20C 13.8V | ac40 | 5190 | Ant1 | 5189.92 | -80000  | -15.41 | 25 | Pass |
| -20C 12V  | ac40 | 5190 | Ant1 | 5190    | 0       | 0      | 25 | Pass |
| -10C 12V  | ac40 | 5190 | Ant1 | 5190    | 0       | 0      | 25 | Pass |
| 0C 12V    | ac40 | 5190 | Ant1 | 5189.96 | -40000  | -7.71  | 25 | Pass |
| 10C 12V   | ac40 | 5190 | Ant1 | 5189.88 | -120000 | -23.12 | 25 | Pass |
| 30C 12V   | ac40 | 5190 | Ant1 | 5190    | 0       | 0      | 25 | Pass |
| 40C 12V   | ac40 | 5190 | Ant1 | 5189.96 | -40000  | -7.71  | 25 | Pass |
| 50C 12V   | ac40 | 5190 | Ant1 | 5190    | 0       | 0      | 25 | Pass |
| 20C 10.2V | ac40 | 5230 | Ant1 | 5230.04 | 40000   | 7.65   | 25 | Pass |
| 20C 12V   | ac40 | 5230 | Ant1 | 5230    | 0       | 0      | 25 | Pass |
| 20C 13.8V | ac40 | 5230 | Ant1 | 5230.04 | 40000   | 7.65   | 25 | Pass |
| -20C 12V  | ac40 | 5230 | Ant1 | 5229.96 | -40000  | -7.65  | 25 | Pass |
| -10C 12V  | ac40 | 5230 | Ant1 | 5229.96 | -40000  | -7.65  | 25 | Pass |
| 0C 12V    | ac40 | 5230 | Ant1 | 5230    | 0       | 0      | 25 | Pass |


|           |      |      |      |         |        |       |    |      |
|-----------|------|------|------|---------|--------|-------|----|------|
| 10C 12V   | ac40 | 5230 | Ant1 | 5230    | 0      | 0     | 25 | Pass |
| 30C 12V   | ac40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65 | 25 | Pass |
| 40C 12V   | ac40 | 5230 | Ant1 | 5230.04 | 40000  | 7.65  | 25 | Pass |
| 50C 12V   | ac40 | 5230 | Ant1 | 5230    | 0      | 0     | 25 | Pass |
| 20C 10.2V | ac40 | 5270 | Ant1 | 5269.96 | -40000 | -7.59 | 25 | Pass |
| 20C 12V   | ac40 | 5270 | Ant1 | 5269.96 | -40000 | -7.59 | 25 | Pass |
| 20C 13.8V | ac40 | 5270 | Ant1 | 5270    | 0      | 0     | 25 | Pass |
| -20C 12V  | ac40 | 5270 | Ant1 | 5270    | 0      | 0     | 25 | Pass |
| -10C 12V  | ac40 | 5270 | Ant1 | 5270    | 0      | 0     | 25 | Pass |
| 0C 12V    | ac40 | 5270 | Ant1 | 5270    | 0      | 0     | 25 | Pass |
| 10C 12V   | ac40 | 5270 | Ant1 | 5269.96 | -40000 | -7.59 | 25 | Pass |
| 30C 12V   | ac40 | 5270 | Ant1 | 5270    | 0      | 0     | 25 | Pass |
| 40C 12V   | ac40 | 5270 | Ant1 | 5270    | 0      | 0     | 25 | Pass |
| 50C 12V   | ac40 | 5270 | Ant1 | 5269.96 | -40000 | -7.59 | 25 | Pass |
| 20C 10.2V | ac40 | 5310 | Ant1 | 5310    | 0      | 0     | 25 | Pass |
| 20C 12V   | ac40 | 5310 | Ant1 | 5310.04 | 40000  | 7.53  | 25 | Pass |
| 20C 13.8V | ac40 | 5310 | Ant1 | 5310    | 0      | 0     | 25 | Pass |
| -20C 12V  | ac40 | 5310 | Ant1 | 5309.96 | -40000 | -7.53 | 25 | Pass |
| -10C 12V  | ac40 | 5310 | Ant1 | 5310    | 0      | 0     | 25 | Pass |
| 0C 12V    | ac40 | 5310 | Ant1 | 5310    | 0      | 0     | 25 | Pass |
| 10C 12V   | ac40 | 5310 | Ant1 | 5309.96 | -40000 | -7.53 | 25 | Pass |
| 30C 12V   | ac40 | 5310 | Ant1 | 5309.96 | -40000 | -7.53 | 25 | Pass |
| 40C 12V   | ac40 | 5310 | Ant1 | 5310    | 0      | 0     | 25 | Pass |
| 50C 12V   | ac40 | 5310 | Ant1 | 5310    | 0      | 0     | 25 | Pass |
| 20C 10.2V | ac40 | 5510 | Ant1 | 5510    | 0      | 0     | 25 | Pass |
| 20C 12V   | ac40 | 5510 | Ant1 | 5509.96 | -40000 | -7.26 | 25 | Pass |
| 20C 13.8V | ac40 | 5510 | Ant1 | 5510    | 0      | 0     | 25 | Pass |
| -20C 12V  | ac40 | 5510 | Ant1 | 5510.12 | 120000 | 21.78 | 25 | Pass |
| -10C 12V  | ac40 | 5510 | Ant1 | 5510    | 0      | 0     | 25 | Pass |
| 0C 12V    | ac40 | 5510 | Ant1 | 5509.96 | -40000 | -7.26 | 25 | Pass |
| 10C 12V   | ac40 | 5510 | Ant1 | 5510    | 0      | 0     | 25 | Pass |
| 30C 12V   | ac40 | 5510 | Ant1 | 5510    | 0      | 0     | 25 | Pass |
| 40C 12V   | ac40 | 5510 | Ant1 | 5510    | 0      | 0     | 25 | Pass |
| 50C 12V   | ac40 | 5510 | Ant1 | 5510    | 0      | 0     | 25 | Pass |
| 20C 10.2V | ac40 | 5550 | Ant1 | 5550    | 0      | 0     | 25 | Pass |
| 20C 12V   | ac40 | 5550 | Ant1 | 5549.96 | -40000 | -7.21 | 25 | Pass |
| 20C 13.8V | ac40 | 5550 | Ant1 | 5550.04 | 40000  | 7.21  | 25 | Pass |
| -20C 12V  | ac40 | 5550 | Ant1 | 5550    | 0      | 0     | 25 | Pass |
| -10C 12V  | ac40 | 5550 | Ant1 | 5550    | 0      | 0     | 25 | Pass |
| 0C 12V    | ac40 | 5550 | Ant1 | 5549.96 | -40000 | -7.21 | 25 | Pass |
| 10C 12V   | ac40 | 5550 | Ant1 | 5550    | 0      | 0     | 25 | Pass |


|           |      |      |      |         |        |       |    |      |
|-----------|------|------|------|---------|--------|-------|----|------|
| 30C 12V   | ac40 | 5550 | Ant1 | 5550    | 0      | 0     | 25 | Pass |
| 40C 12V   | ac40 | 5550 | Ant1 | 5550    | 0      | 0     | 25 | Pass |
| 50C 12V   | ac40 | 5550 | Ant1 | 5550    | 0      | 0     | 25 | Pass |
| 20C 10.2V | ac40 | 5670 | Ant1 | 5670    | 0      | 0     | 25 | Pass |
| 20C 12V   | ac40 | 5670 | Ant1 | 5670.04 | 40000  | 7.05  | 25 | Pass |
| 20C 13.8V | ac40 | 5670 | Ant1 | 5670    | 0      | 0     | 25 | Pass |
| -20C 12V  | ac40 | 5670 | Ant1 | 5669.96 | -40000 | -7.05 | 25 | Pass |
| -10C 12V  | ac40 | 5670 | Ant1 | 5670    | 0      | 0     | 25 | Pass |
| 0C 12V    | ac40 | 5670 | Ant1 | 5670    | 0      | 0     | 25 | Pass |
| 10C 12V   | ac40 | 5670 | Ant1 | 5670    | 0      | 0     | 25 | Pass |
| 30C 12V   | ac40 | 5670 | Ant1 | 5670    | 0      | 0     | 25 | Pass |
| 40C 12V   | ac40 | 5670 | Ant1 | 5669.96 | -40000 | -7.05 | 25 | Pass |
| 50C 12V   | ac40 | 5670 | Ant1 | 5670    | 0      | 0     | 25 | Pass |
| 20C 10.2V | ac40 | 5755 | Ant1 | 5755.04 | 40000  | 6.95  | 25 | Pass |
| 20C 12V   | ac40 | 5755 | Ant1 | 5754.96 | -40000 | -6.95 | 25 | Pass |
| 20C 13.8V | ac40 | 5755 | Ant1 | 5755    | 0      | 0     | 25 | Pass |
| -20C 12V  | ac40 | 5755 | Ant1 | 5754.96 | -40000 | -6.95 | 25 | Pass |
| -10C 12V  | ac40 | 5755 | Ant1 | 5755    | 0      | 0     | 25 | Pass |
| 0C 12V    | ac40 | 5755 | Ant1 | 5755    | 0      | 0     | 25 | Pass |
| 10C 12V   | ac40 | 5755 | Ant1 | 5755    | 0      | 0     | 25 | Pass |
| 30C 12V   | ac40 | 5755 | Ant1 | 5755    | 0      | 0     | 25 | Pass |
| 40C 12V   | ac40 | 5755 | Ant1 | 5755    | 0      | 0     | 25 | Pass |
| 50C 12V   | ac40 | 5755 | Ant1 | 5755.04 | 40000  | 6.95  | 25 | Pass |
| 20C 10.2V | ac40 | 5795 | Ant1 | 5795.04 | 40000  | 6.9   | 25 | Pass |
| 20C 12V   | ac40 | 5795 | Ant1 | 5795    | 0      | 0     | 25 | Pass |
| 20C 13.8V | ac40 | 5795 | Ant1 | 5795.04 | 40000  | 6.9   | 25 | Pass |
| -20C 12V  | ac40 | 5795 | Ant1 | 5795    | 0      | 0     | 25 | Pass |
| -10C 12V  | ac40 | 5795 | Ant1 | 5795    | 0      | 0     | 25 | Pass |
| 0C 12V    | ac40 | 5795 | Ant1 | 5795    | 0      | 0     | 25 | Pass |
| 10C 12V   | ac40 | 5795 | Ant1 | 5795    | 0      | 0     | 25 | Pass |
| 30C 12V   | ac40 | 5795 | Ant1 | 5795    | 0      | 0     | 25 | Pass |
| 40C 12V   | ac40 | 5795 | Ant1 | 5795    | 0      | 0     | 25 | Pass |
| 50C 12V   | ac40 | 5795 | Ant1 | 5795.04 | 40000  | 6.9   | 25 | Pass |
| 20C 10.2V | ac80 | 5210 | Ant1 | 5210    | 0      | 0     | 25 | Pass |
| 20C 12V   | ac80 | 5210 | Ant1 | 5210    | 0      | 0     | 25 | Pass |
| 20C 13.8V | ac80 | 5210 | Ant1 | 5210    | 0      | 0     | 25 | Pass |
| -20C 12V  | ac80 | 5210 | Ant1 | 5210    | 0      | 0     | 25 | Pass |
| -10C 12V  | ac80 | 5210 | Ant1 | 5210    | 0      | 0     | 25 | Pass |
| 0C 12V    | ac80 | 5210 | Ant1 | 5210    | 0      | 0     | 25 | Pass |
| 10C 12V   | ac80 | 5210 | Ant1 | 5210    | 0      | 0     | 25 | Pass |
| 30C 12V   | ac80 | 5210 | Ant1 | 5210    | 0      | 0     | 25 | Pass |

|           |      |      |      |      |   |   |    |      |
|-----------|------|------|------|------|---|---|----|------|
| 40C 12V   | ac80 | 5210 | Ant1 | 5210 | 0 | 0 | 25 | Pass |
| 50C 12V   | ac80 | 5210 | Ant1 | 5210 | 0 | 0 | 25 | Pass |
| 20C 10.2V | ac80 | 5290 | Ant1 | 5290 | 0 | 0 | 25 | Pass |
| 20C 12V   | ac80 | 5290 | Ant1 | 5290 | 0 | 0 | 25 | Pass |
| 20C 13.8V | ac80 | 5290 | Ant1 | 5290 | 0 | 0 | 25 | Pass |
| -20C 12V  | ac80 | 5290 | Ant1 | 5290 | 0 | 0 | 25 | Pass |
| -10C 12V  | ac80 | 5290 | Ant1 | 5290 | 0 | 0 | 25 | Pass |
| 0C 12V    | ac80 | 5290 | Ant1 | 5290 | 0 | 0 | 25 | Pass |
| 10C 12V   | ac80 | 5290 | Ant1 | 5290 | 0 | 0 | 25 | Pass |
| 30C 12V   | ac80 | 5290 | Ant1 | 5290 | 0 | 0 | 25 | Pass |
| 40C 12V   | ac80 | 5290 | Ant1 | 5290 | 0 | 0 | 25 | Pass |
| 50C 12V   | ac80 | 5290 | Ant1 | 5290 | 0 | 0 | 25 | Pass |
| 20C 10.2V | ac80 | 5530 | Ant1 | 5530 | 0 | 0 | 25 | Pass |
| 20C 12V   | ac80 | 5530 | Ant1 | 5530 | 0 | 0 | 25 | Pass |
| 20C 13.8V | ac80 | 5530 | Ant1 | 5530 | 0 | 0 | 25 | Pass |
| -20C 12V  | ac80 | 5530 | Ant1 | 5530 | 0 | 0 | 25 | Pass |
| -10C 12V  | ac80 | 5530 | Ant1 | 5530 | 0 | 0 | 25 | Pass |
| 0C 12V    | ac80 | 5530 | Ant1 | 5530 | 0 | 0 | 25 | Pass |
| 10C 12V   | ac80 | 5530 | Ant1 | 5530 | 0 | 0 | 25 | Pass |
| 30C 12V   | ac80 | 5530 | Ant1 | 5530 | 0 | 0 | 25 | Pass |
| 40C 12V   | ac80 | 5530 | Ant1 | 5530 | 0 | 0 | 25 | Pass |
| 50C 12V   | ac80 | 5530 | Ant1 | 5530 | 0 | 0 | 25 | Pass |
| 20C 10.2V | ac80 | 5775 | Ant1 | 5775 | 0 | 0 | 25 | Pass |
| 20C 12V   | ac80 | 5775 | Ant1 | 5775 | 0 | 0 | 25 | Pass |
| 20C 13.8V | ac80 | 5775 | Ant1 | 5775 | 0 | 0 | 25 | Pass |
| -20C 12V  | ac80 | 5775 | Ant1 | 5775 | 0 | 0 | 25 | Pass |
| -10C 12V  | ac80 | 5775 | Ant1 | 5775 | 0 | 0 | 25 | Pass |
| 0C 12V    | ac80 | 5775 | Ant1 | 5775 | 0 | 0 | 25 | Pass |
| 10C 12V   | ac80 | 5775 | Ant1 | 5775 | 0 | 0 | 25 | Pass |
| 30C 12V   | ac80 | 5775 | Ant1 | 5775 | 0 | 0 | 25 | Pass |
| 40C 12V   | ac80 | 5775 | Ant1 | 5775 | 0 | 0 | 25 | Pass |
| 50C 12V   | ac80 | 5775 | Ant1 | 5775 | 0 | 0 | 25 | Pass |


## -6dB Bandwidth

| Condition | Mode | Frequency (MHz) | Antenna | -6 dB Bandwidth (MHz) | Limit -6 dB Bandwidth (MHz) | Verdict |
|-----------|------|-----------------|---------|-----------------------|-----------------------------|---------|
| NVNT      | a    | 5745            | Ant1    | 16.284                | 0.5                         | Pass    |
| NVNT      | a    | 5785            | Ant1    | 16.269                | 0.5                         | Pass    |
| NVNT      | a    | 5825            | Ant1    | 16.032                | 0.5                         | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 17.532                | 0.5                         | Pass    |
| NVNT      | n20  | 5785            | Ant1    | 17.292                | 0.5                         | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 17.271                | 0.5                         | Pass    |
| NVNT      | n40  | 5755            | Ant1    | 35.64                 | 0.5                         | Pass    |
| NVNT      | n40  | 5795            | Ant1    | 35.97                 | 0.5                         | Pass    |
| NVNT      | ac20 | 5745            | Ant1    | 17.55                 | 0.5                         | Pass    |
| NVNT      | ac20 | 5785            | Ant1    | 17.268                | 0.5                         | Pass    |
| NVNT      | ac20 | 5825            | Ant1    | 17.55                 | 0.5                         | Pass    |
| NVNT      | ac40 | 5755            | Ant1    | 35.652                | 0.5                         | Pass    |
| NVNT      | ac40 | 5795            | Ant1    | 35.64                 | 0.5                         | Pass    |
| NVNT      | ac80 | 5775            | Ant1    | 76.38                 | 0.5                         | Pass    |

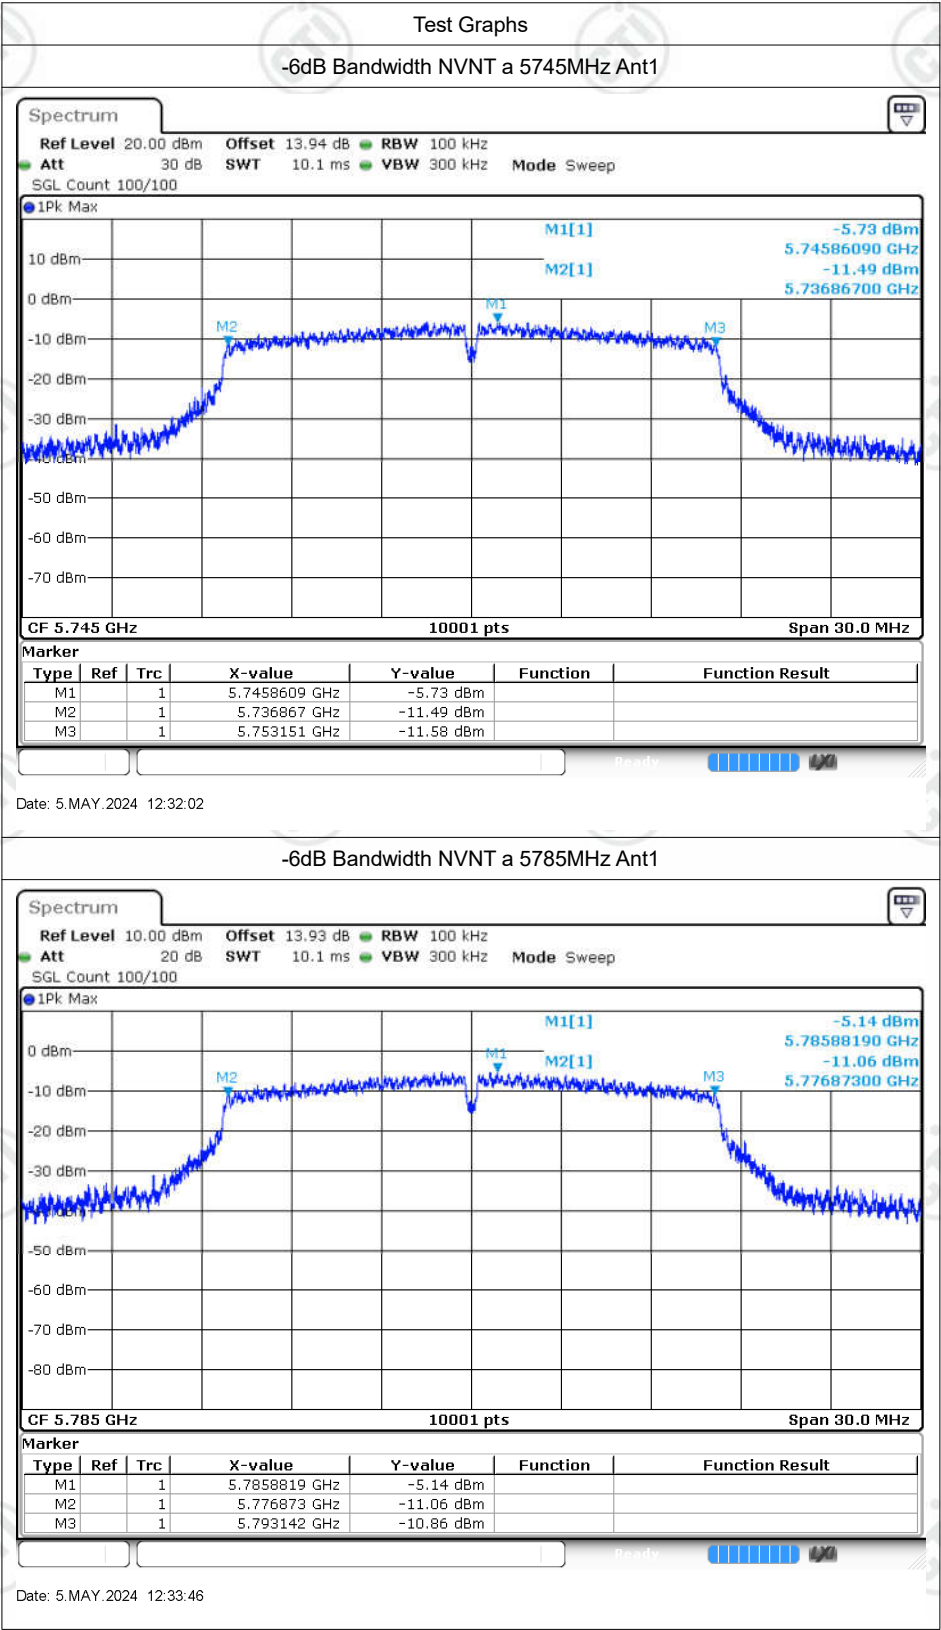


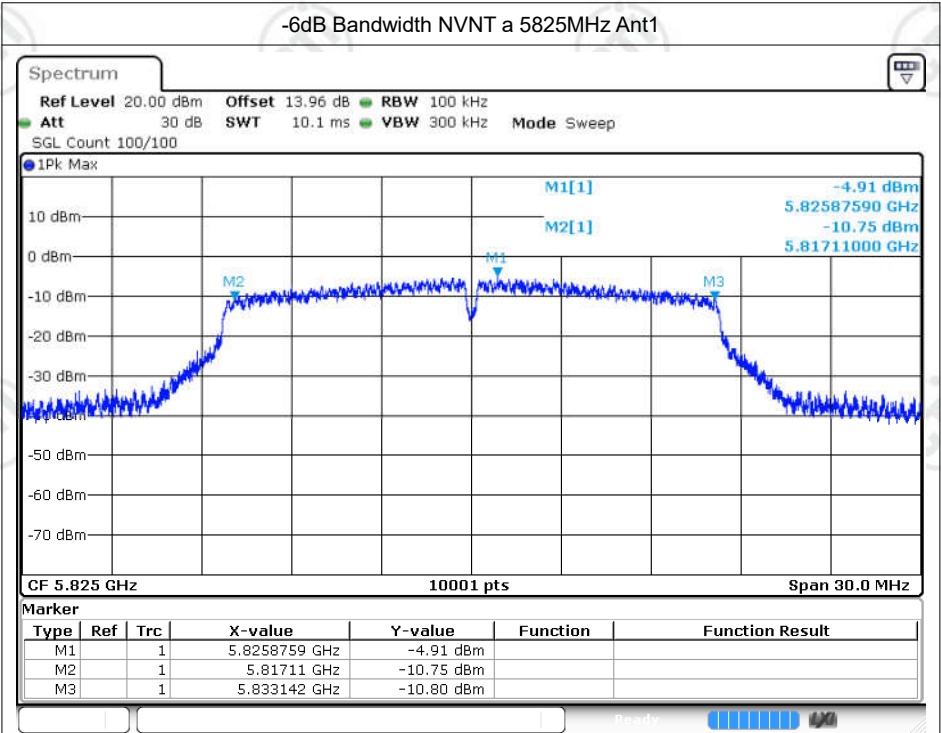


Date: 5.MAY.2024 12:34:41

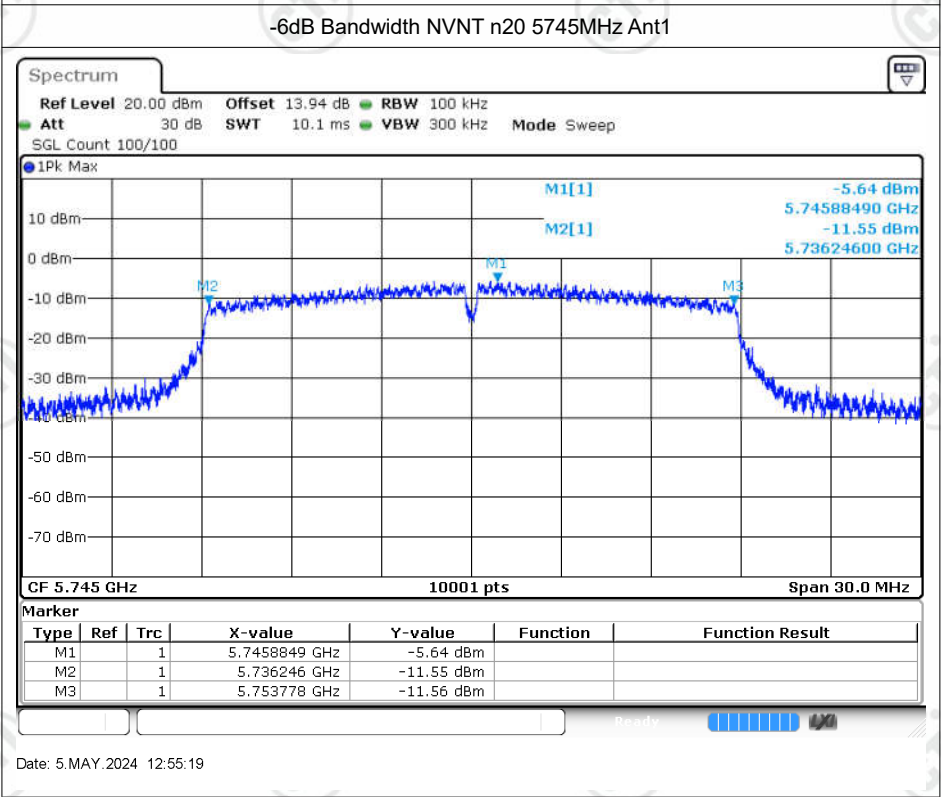


Date: 5.MAY.2024 12:55:19

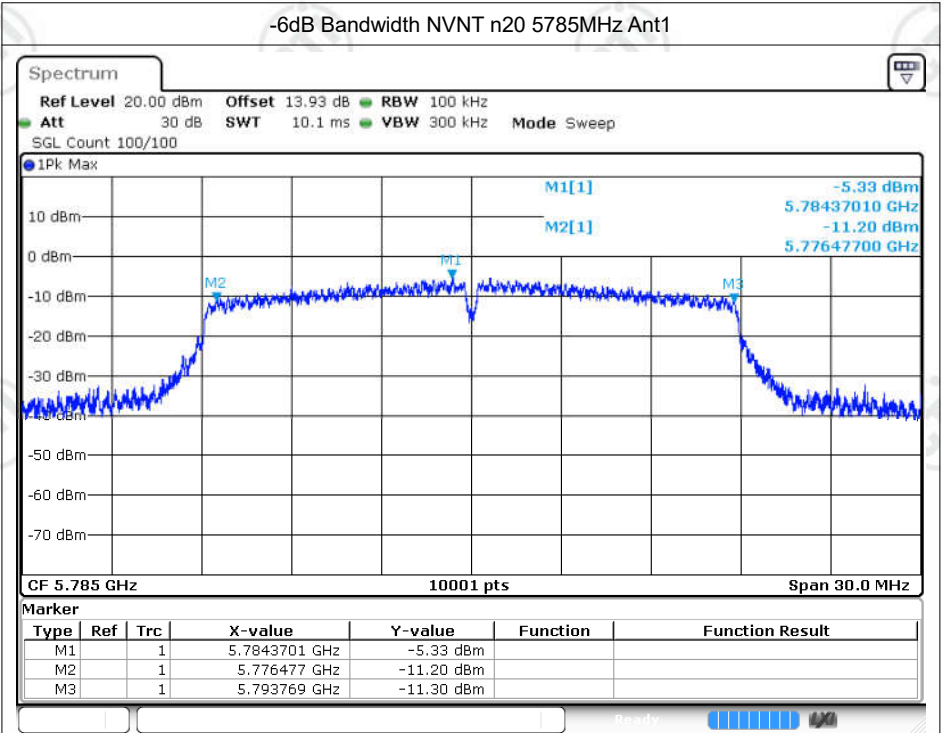


Date: 5.MAY.2024 12:56:51

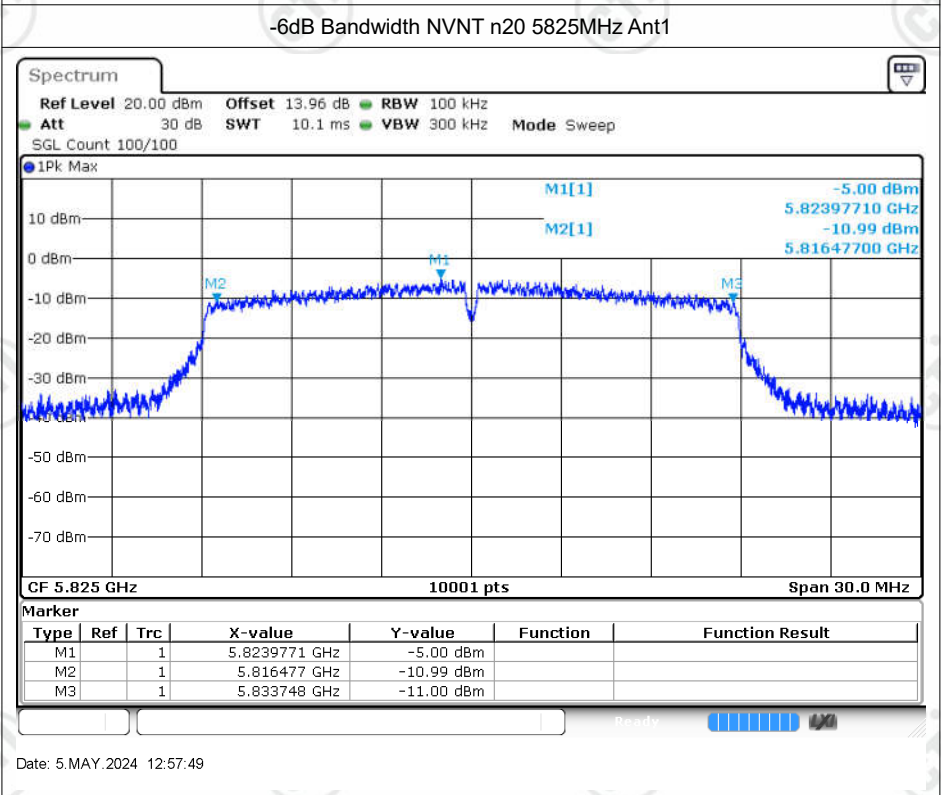


Date: 5.MAY.2024 12:57:49

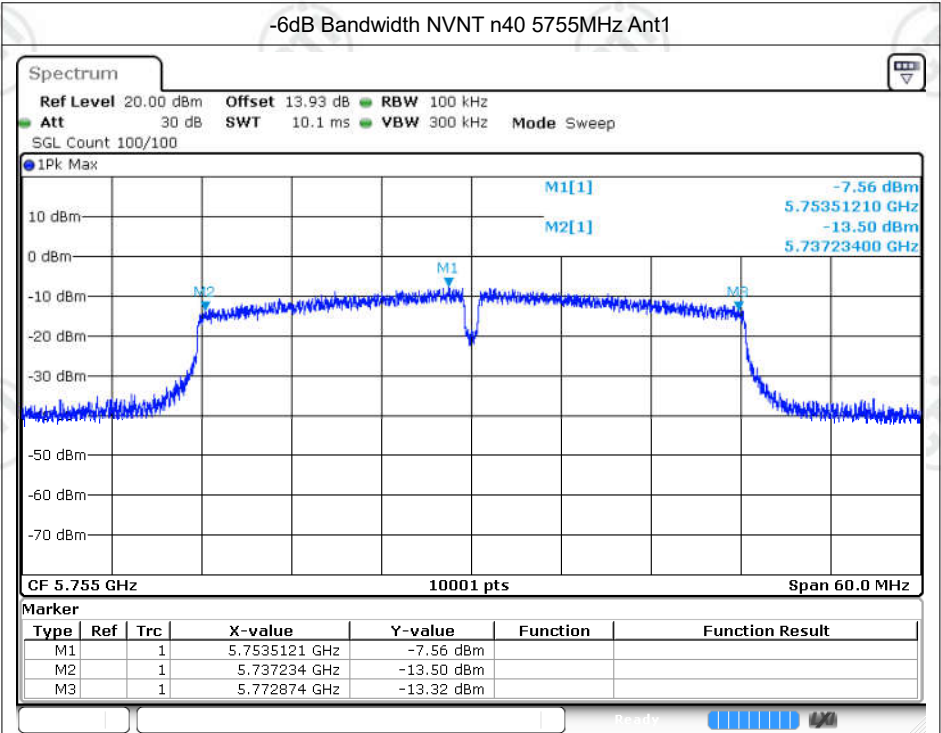


Date: 5.MAY.2024 13:14:53

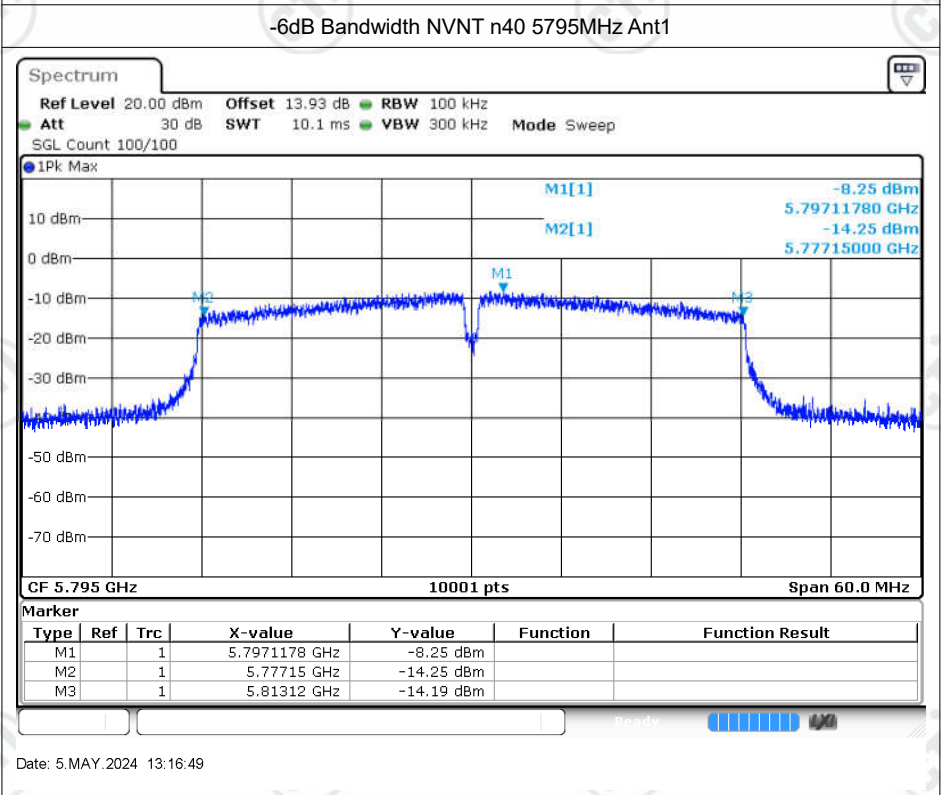


Date: 5.MAY.2024 13:16:49

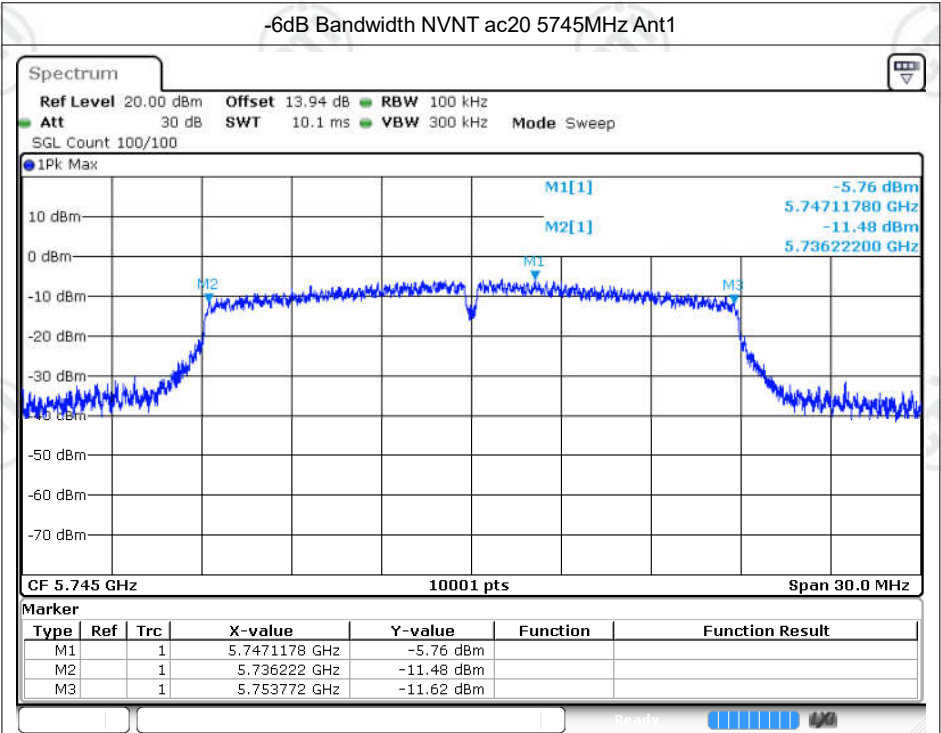


Date: 5.MAY.2024 13:35:52

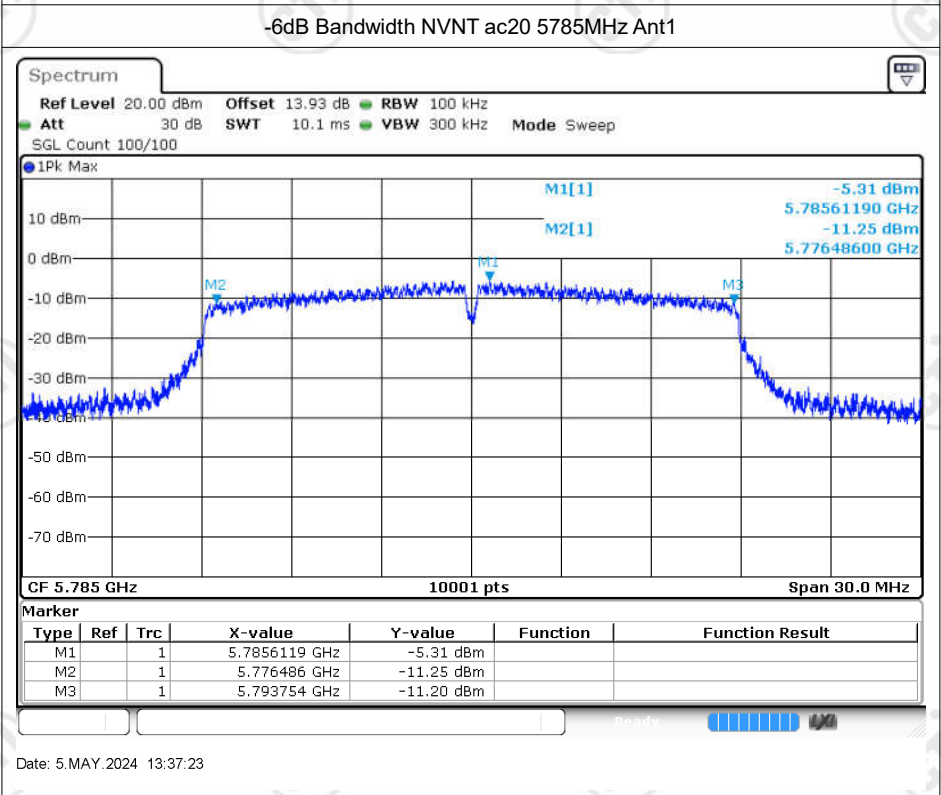


Date: 5.MAY.2024 13:37:23

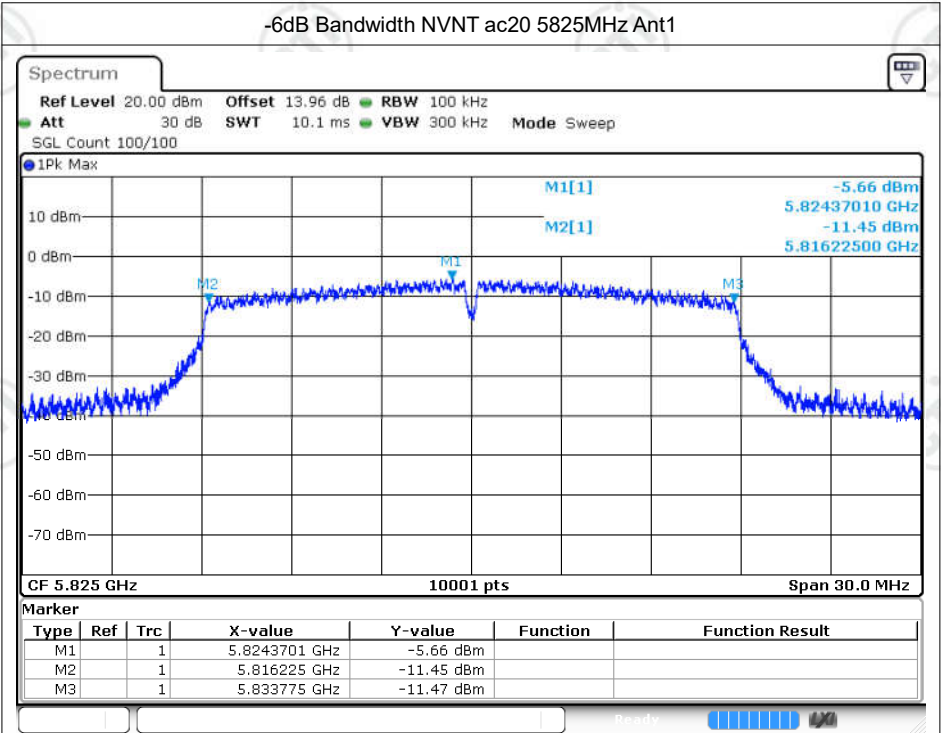


Date: 5.MAY.2024 13:38:12

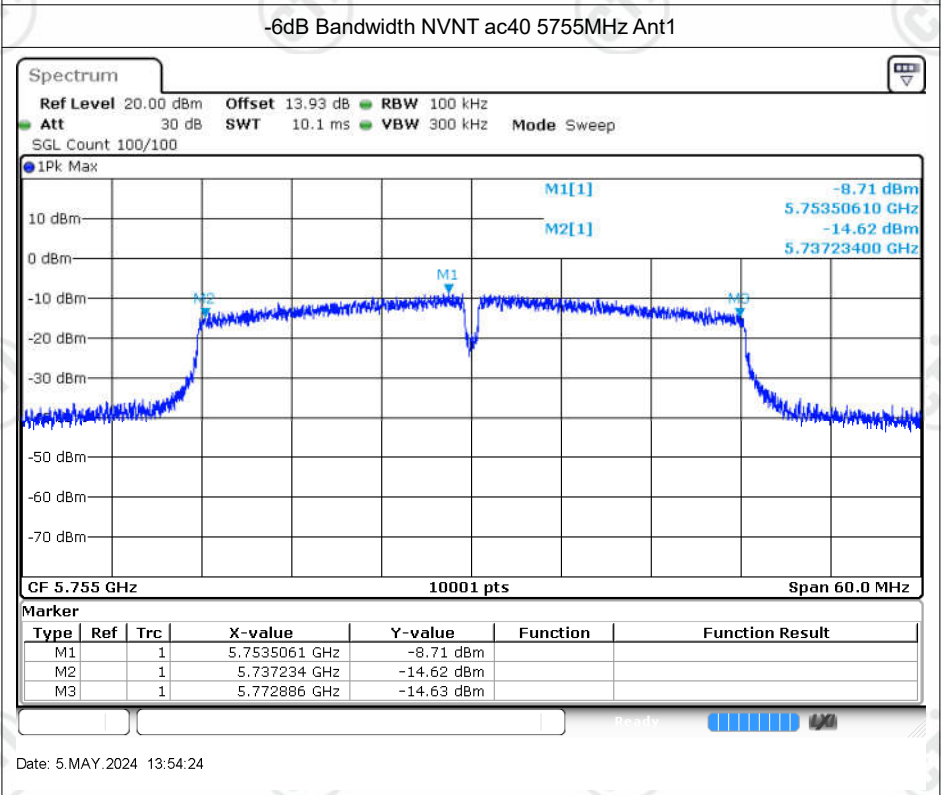

Date: 5.MAY.2024 13:54:24

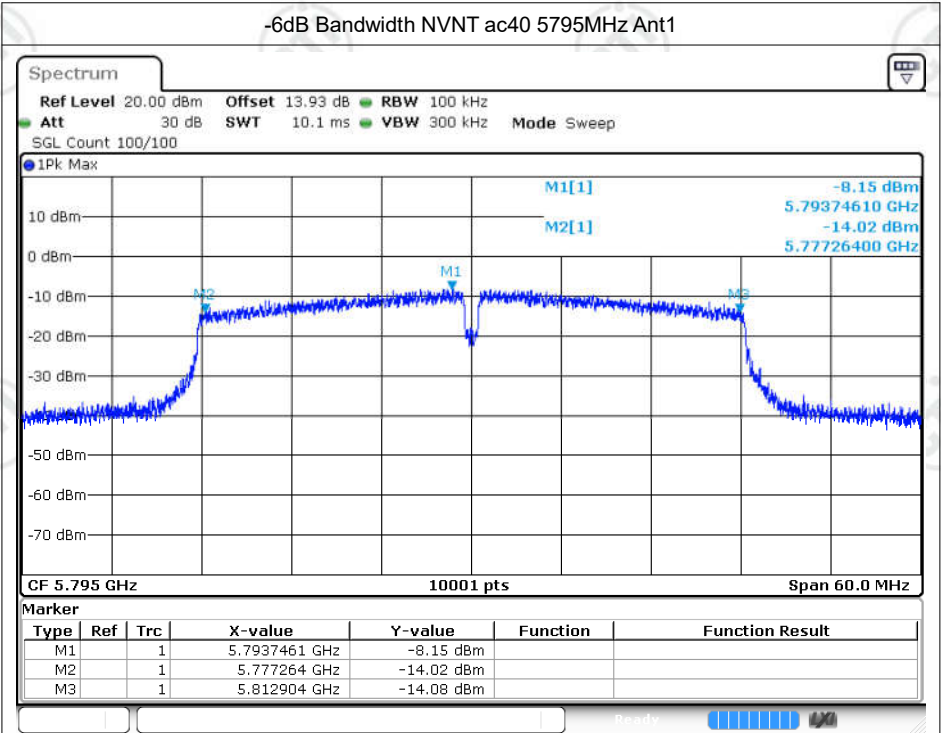

Date: 5.MAY.2024 13:56:06

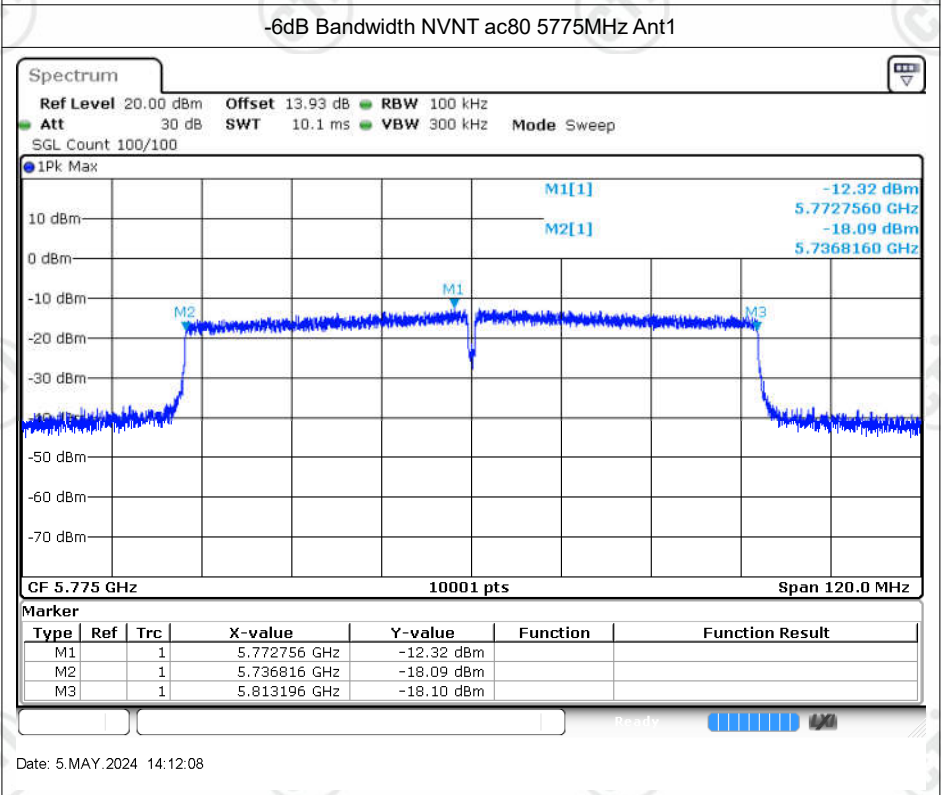

Date: 5.MAY.2024 14:12:08

\*\*\* End of Report \*\*\*