



CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:QPSK CC2:QPSK_CC1:2670.5 CC2:2682.5MHz_CC1: 1@0 CC2:
1@0

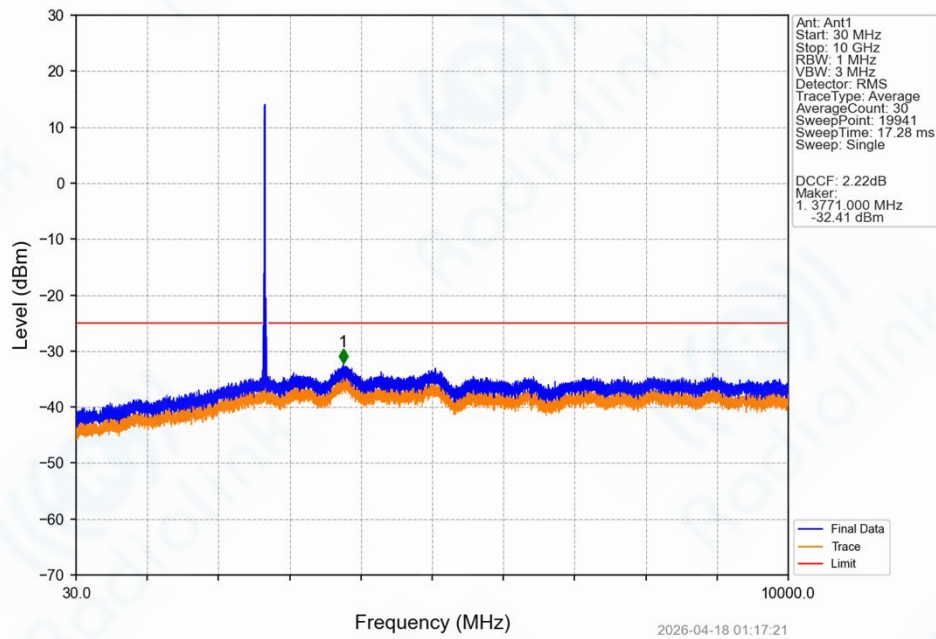


CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:QPSK CC2:QPSK_CC1:2670.5 CC2:2682.5MHz_CC1: 1@0 CC2:
1@0

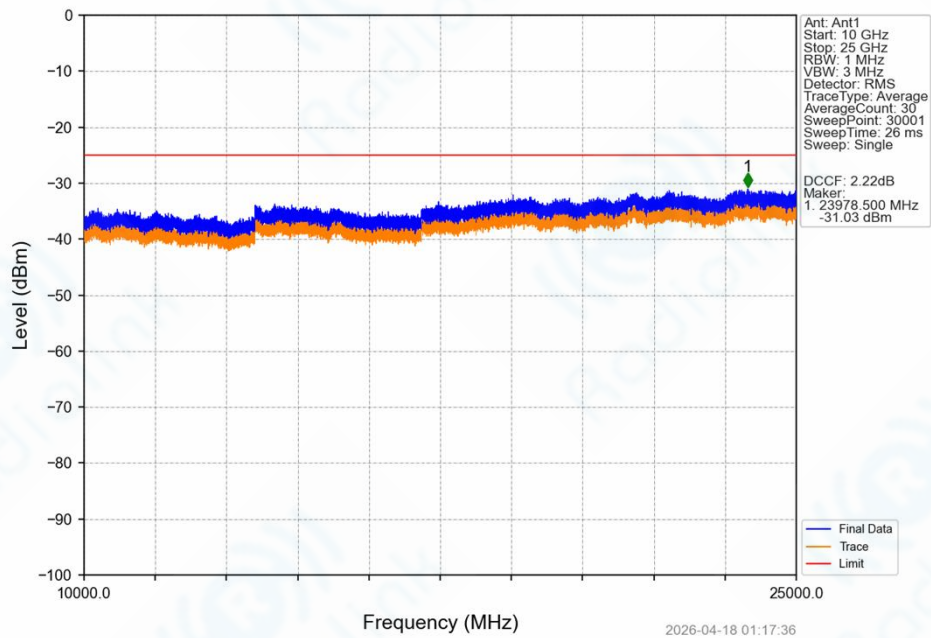


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:QPSK CC2:QPSK_CC1:2670.5 CC2:2682.5MHz_CC1: 1@0 CC2:
1@0

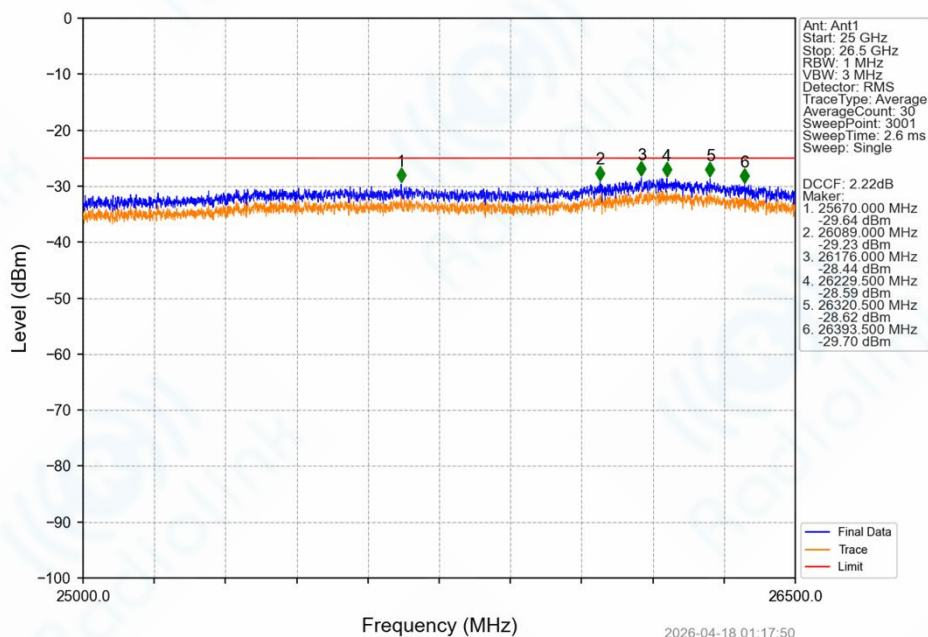

CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:QPSK CC2:QPSK_CC1:2670.5 CC2:2682.5MHz_CC1: 1@49 CC2:
1@74

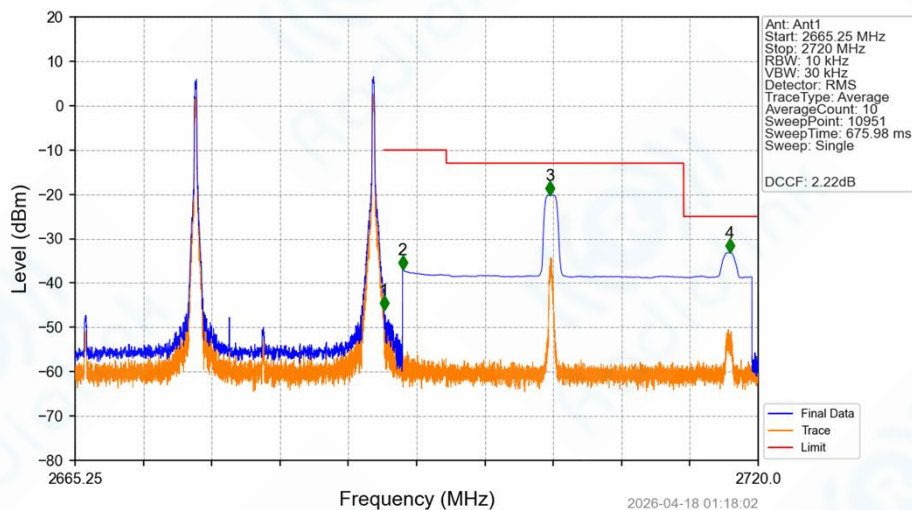


Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
2665.25	2690	0.02	CHP	/	/	/	/	/
2690	2691	0.02	CHP	1	2690.010	-46.03	-10	Pass
2691	2695	1	CHP	2	2691.500	-37.01	-10	Pass
2695	2714.023	1	CHP	3	2703.325	-20.21	-13	Pass
2714.023	2720	1	CHP	4	2717.705	-33.17	-25	Pass

Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:QPSK CC2:QPSK_CC1:2670.5 CC2:2682.5MHz_CC1: 50@0 CC2: 75@0

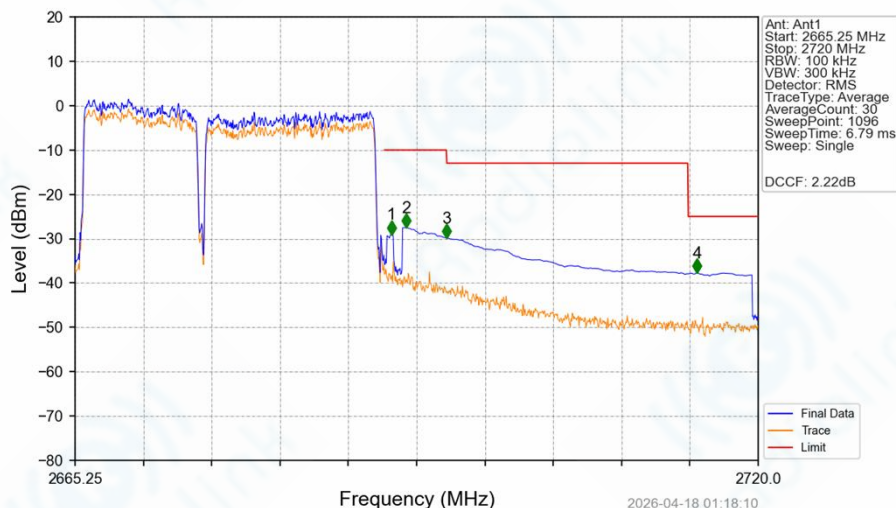

Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
2665.25	2690	0.1	/	/	/	/	/	/
2690	2691	0.487	CHP	1	2690.600	-29.03	-10	Pass
2691	2695	1	CHP	2	2691.800	-27.47	-10	Pass
2695	2714.353	1	CHP	3	2695.050	-29.81	-13	Pass
2714.353	2720	1	CHP	4	2715.100	-37.66	-25	Pass


CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:QPSK CC2:QPSK_CC1:2670.5 CC2:2682.5MHz_CC1: 50@0 CC2: 75@0

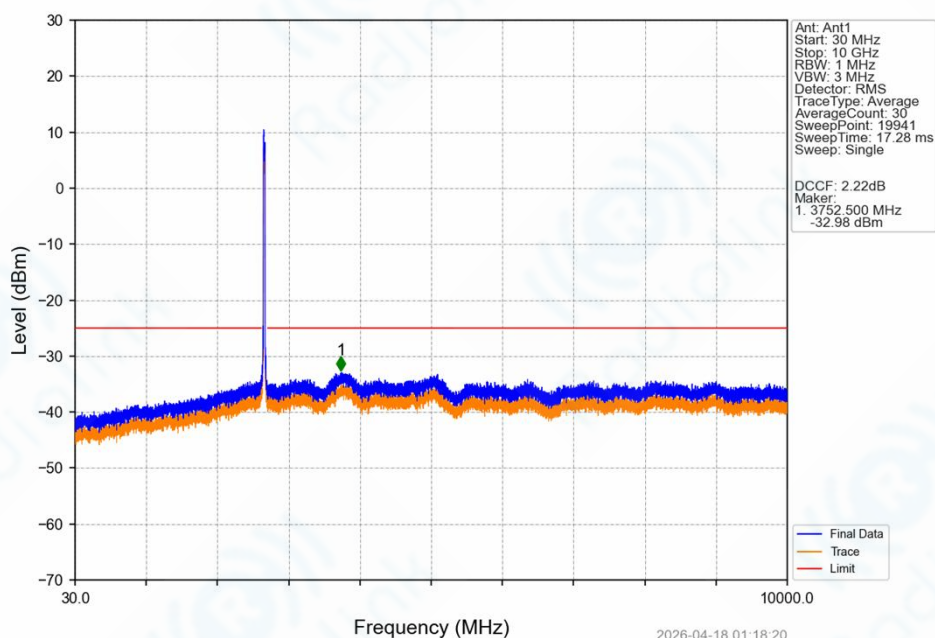


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:QPSK CC2:QPSK_CC1:2670.5 CC2:2682.5MHz_CC1: 50@0 CC2: 75@0

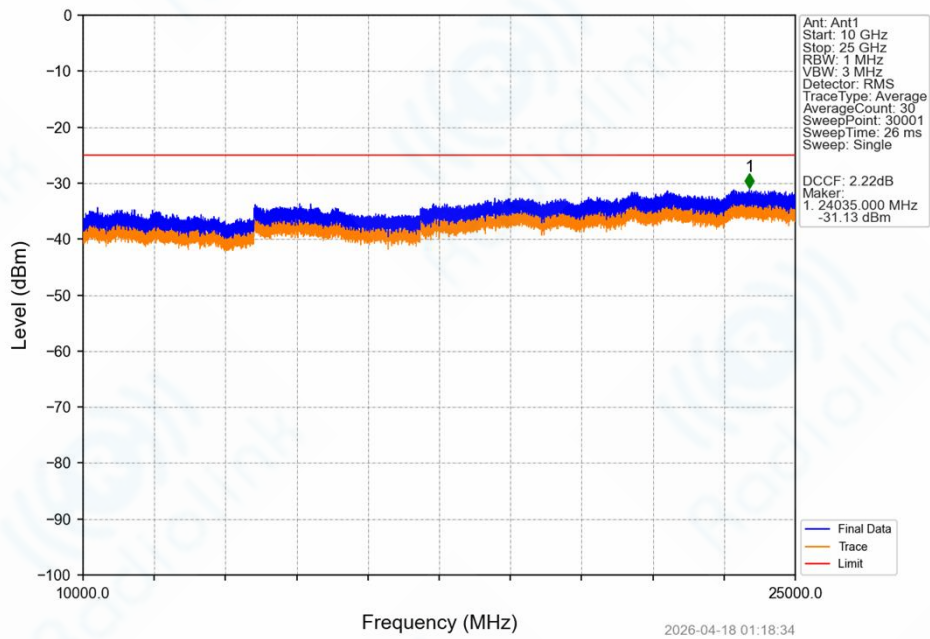

CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:QPSK CC2:QPSK_CC1:2670.5 CC2:2682.5MHz_CC1: 50@0 CC2: 75@0

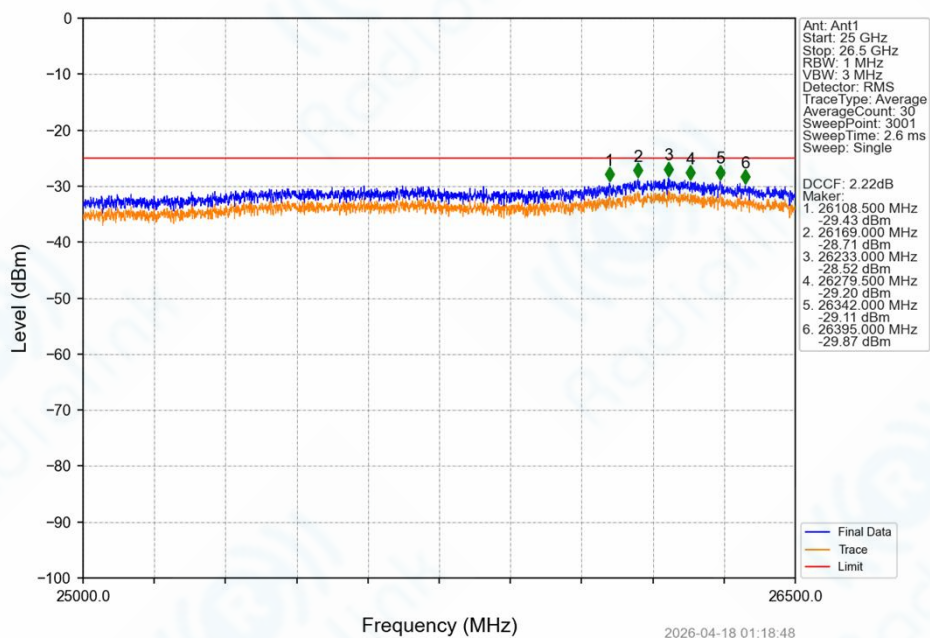


Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China

Tel: +86 0755 23080694


CA_41C_SISO_NTNV_CC1:10_CC2:15MHz_CC1:16QAM_CC2:16QAM_CC1:2501_CC2:2513MHz_CC1: 1@0_CC2: 1@0

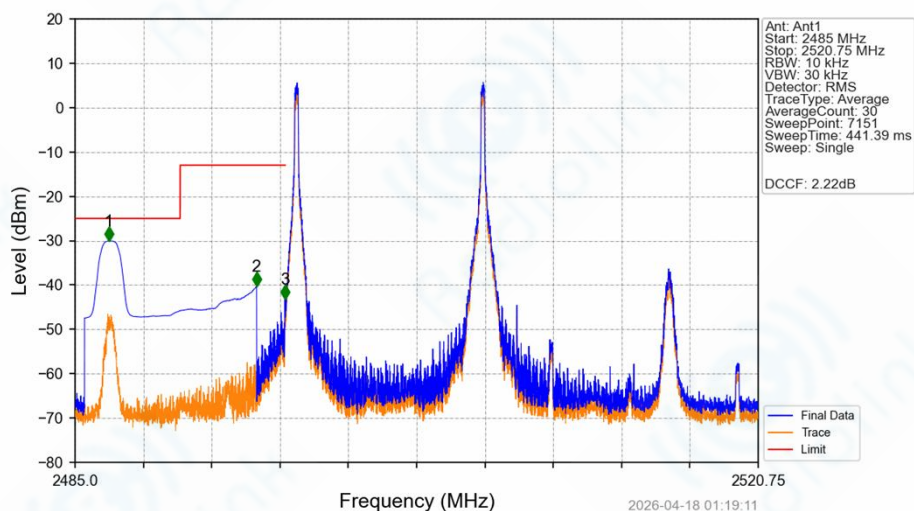


CA_41C_SISO_NTNV_CC1:10_CC2:15MHz_CC1:16QAM_CC2:16QAM_CC1:2501_CC2:2513MHz_CC1: 1@0_CC2: 1@0

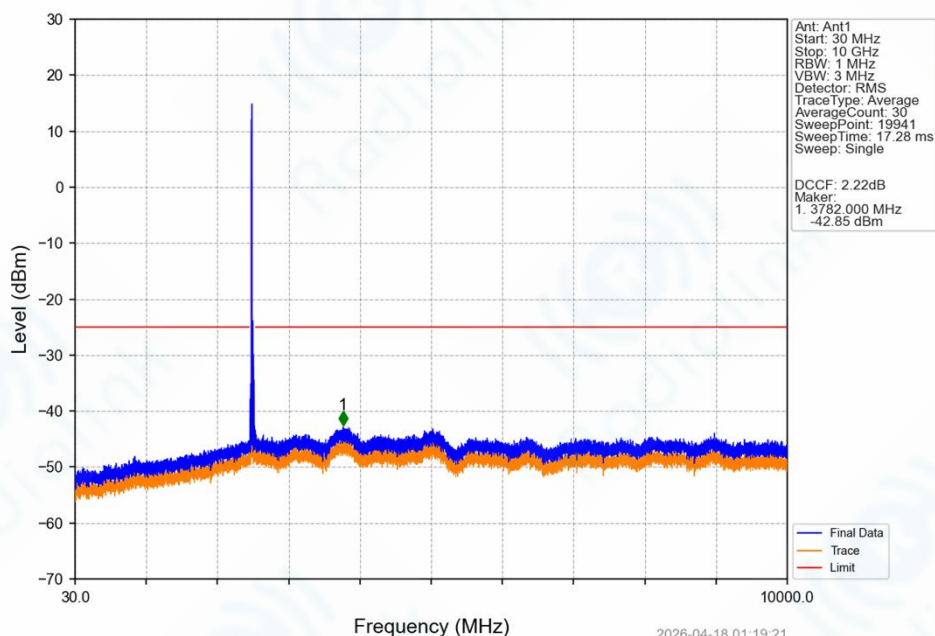

CA_41C_SISO_NTNV_CC1:10_CC2:15MHz_CC1:16QAM_CC2:16QAM_CC1:2501_CC2:2513MHz_CC1: 1@0_CC2: 1@0

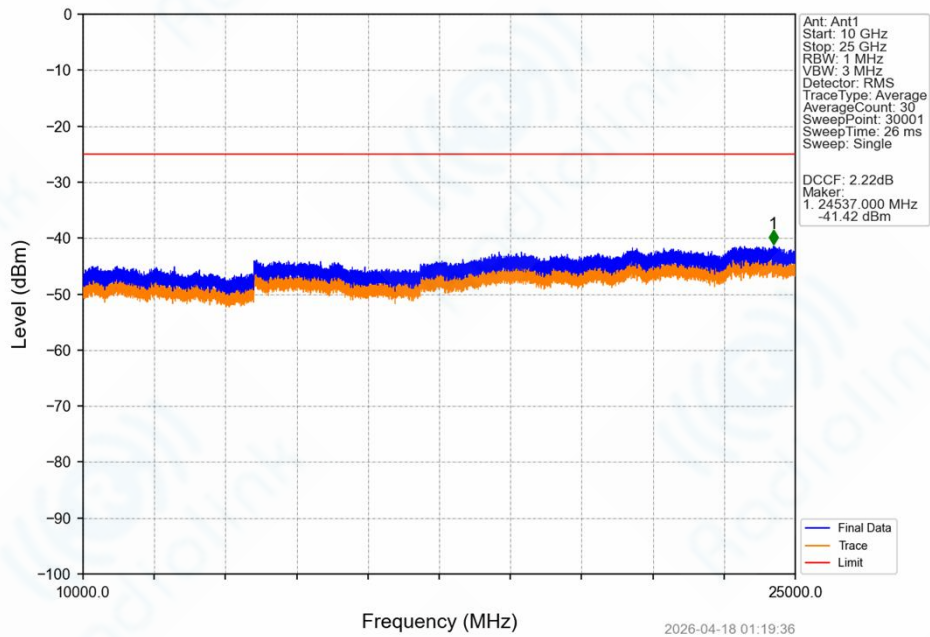


CA_41C_SISO_NTNV_CC1:10_CC2:15MHz_CC1:16QAM_CC2:16QAM_CC1:2501_CC2:2513MHz_CC1: 1@0_CC2: 1@0

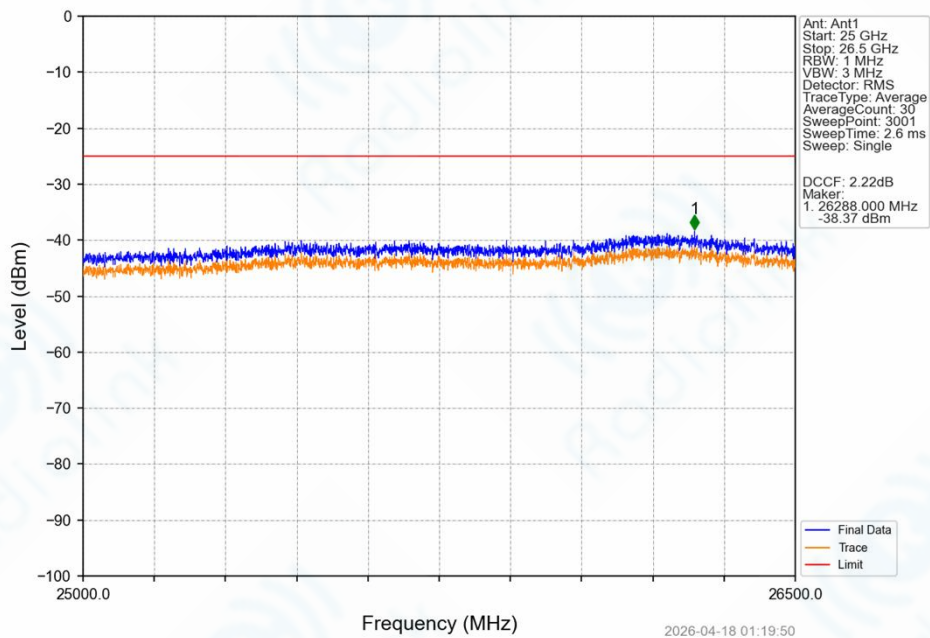
Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China


Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:16QAM CC2:16QAM_CC1:2501 CC2:2513MHz_CC1: 50@0 CC2: 75@0

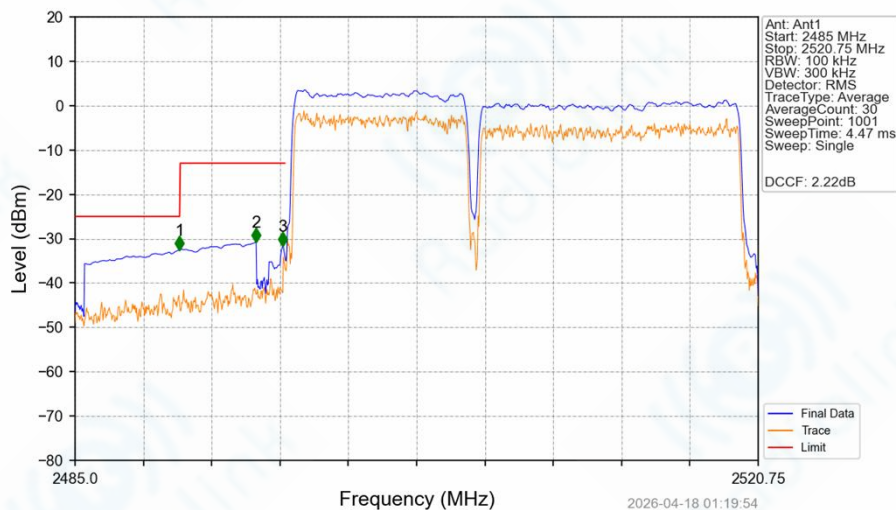

Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
2485	2490.5	1	CHP	1	2490.470	-32.53	-25	Pass
2490.5	2495	1	CHP	2	2494.474	-30.85	-13	Pass
2495	2496	0.25	CHP	3	2495.868	-31.73	-13	Pass
2496	2520.75	0.25	CHP	/	/	/	/	/


CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:16QAM CC2:16QAM_CC1:2501 CC2:2513MHz_CC1: 50@0 CC2: 75@0

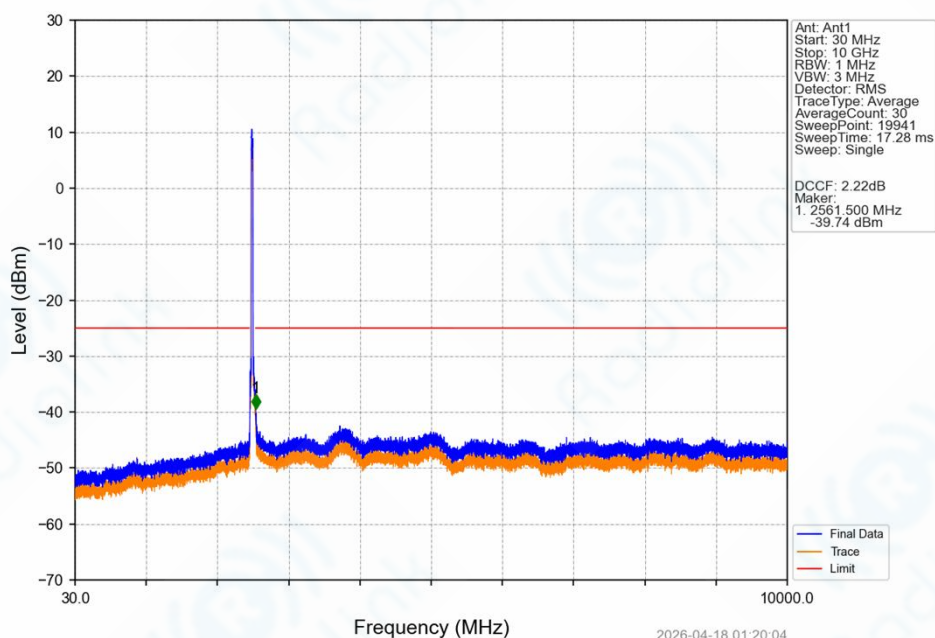


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694


CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:16QAM CC2:16QAM_CC1:2501 CC2:2513MHz_CC1: 50@0 CC2:
75@0

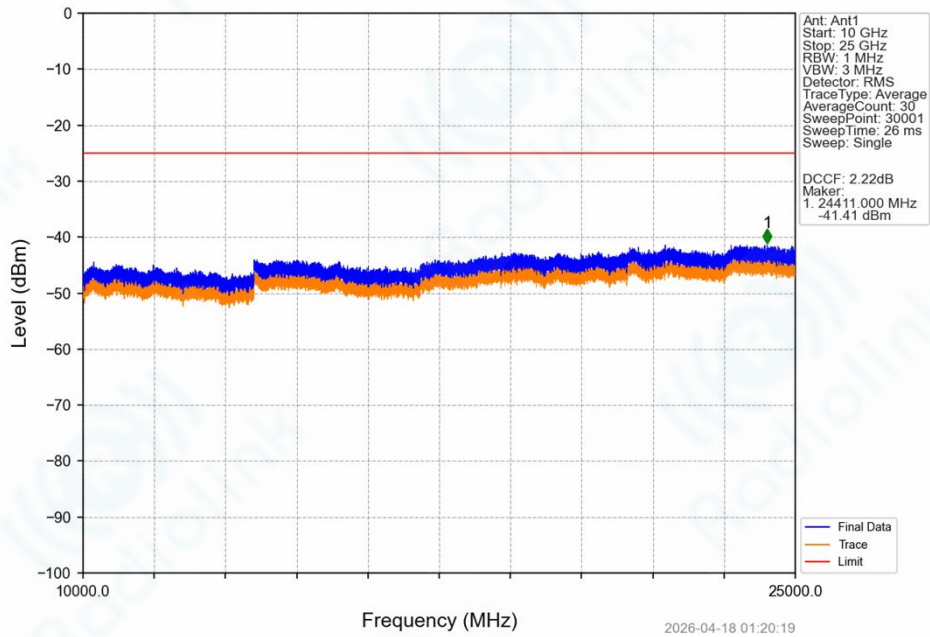


CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:16QAM CC2:16QAM_CC1:2501 CC2:2513MHz_CC1: 50@0 CC2:
75@0

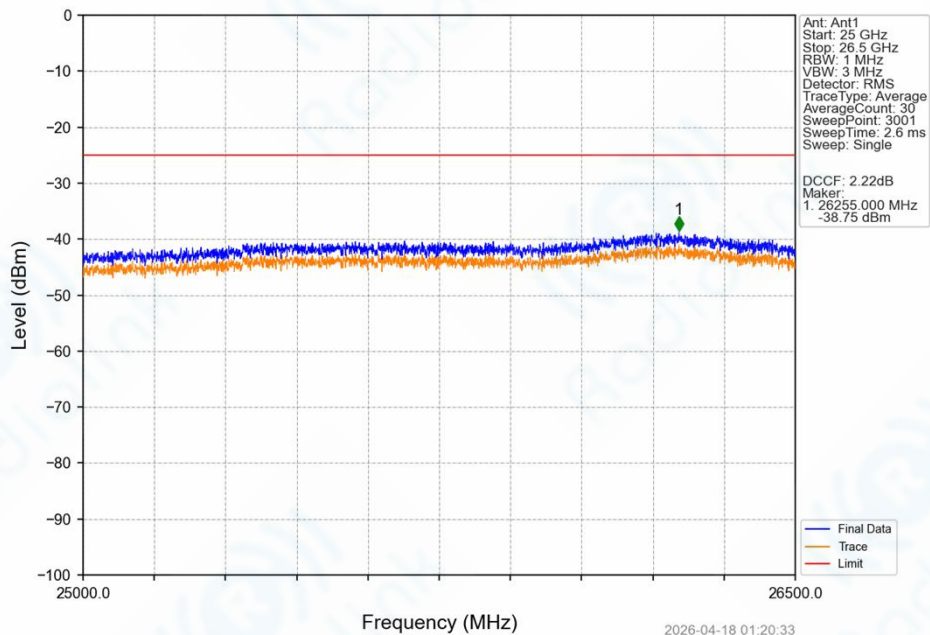

CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:16QAM CC2:16QAM_CC1:2670.5 CC2:2682.5MHz_CC1: 1@0 CC2:
1@0

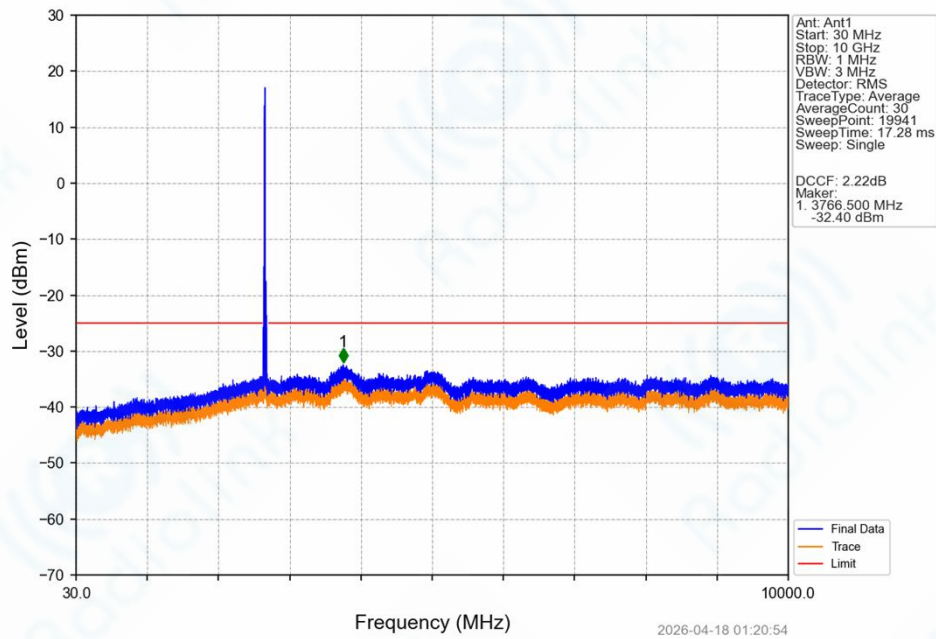


CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:16QAM CC2:16QAM_CC1:2670.5 CC2:2682.5MHz_CC1: 1@0 CC2:
1@0

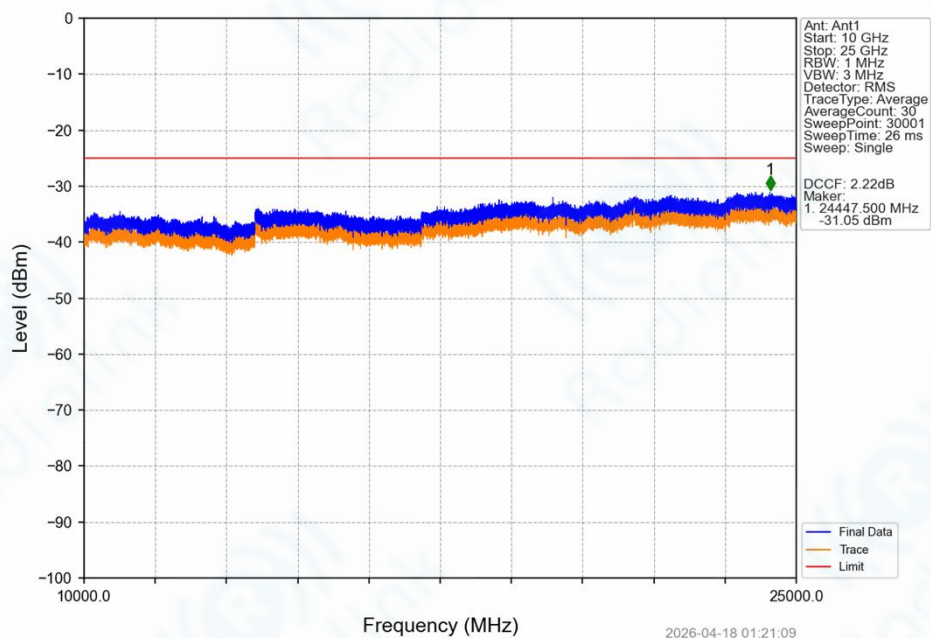


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:16QAM CC2:16QAM_CC1:2670.5 CC2:2682.5MHz_CC1: 1@0 CC2: 1@0

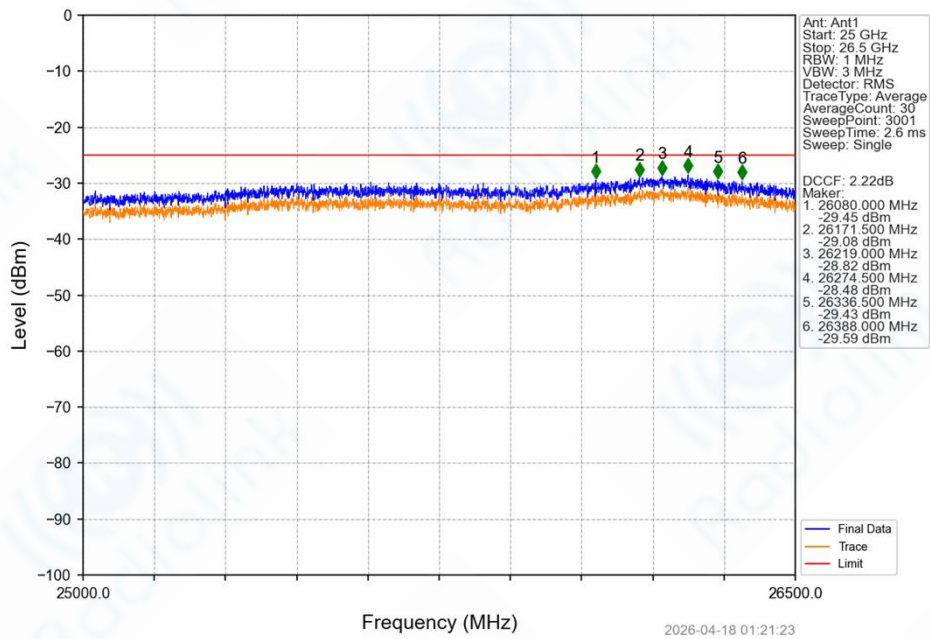

CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:16QAM CC2:16QAM_CC1:2670.5 CC2:2682.5MHz_CC1: 1@49 CC2: 1@74

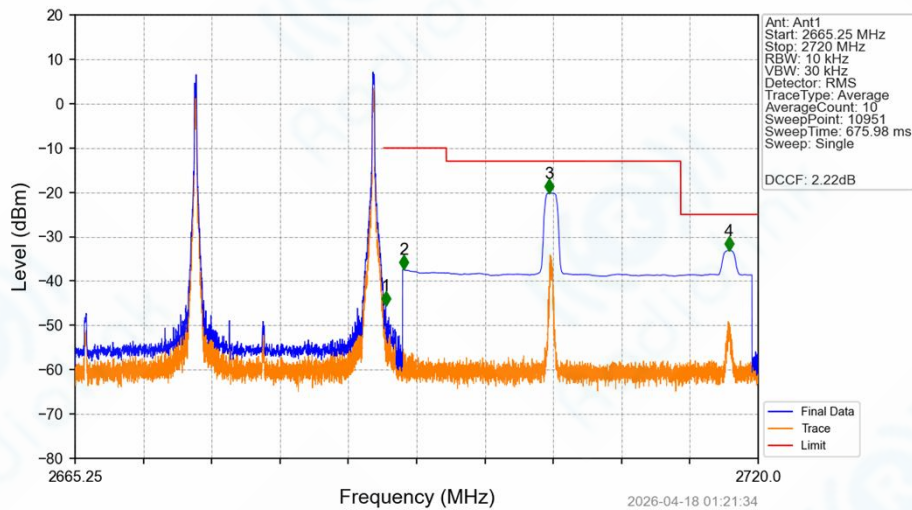


Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
2665.25	2690	0.02	CHP	/	/	/	/	/
2690	2691	0.02	CHP	1	2690.140	-45.47	-10	Pass
2691	2695	1	CHP	2	2691.605	-37.39	-10	Pass
2695	2713.787	1	CHP	3	2703.245	-20.22	-13	Pass
2713.787	2720	1	CHP	4	2717.640	-33.14	-25	Pass

Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China


Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:16QAM CC2:16QAM_CC1:2670.5 CC2:2682.5MHz_CC1: 50@0 CC2: 75@0

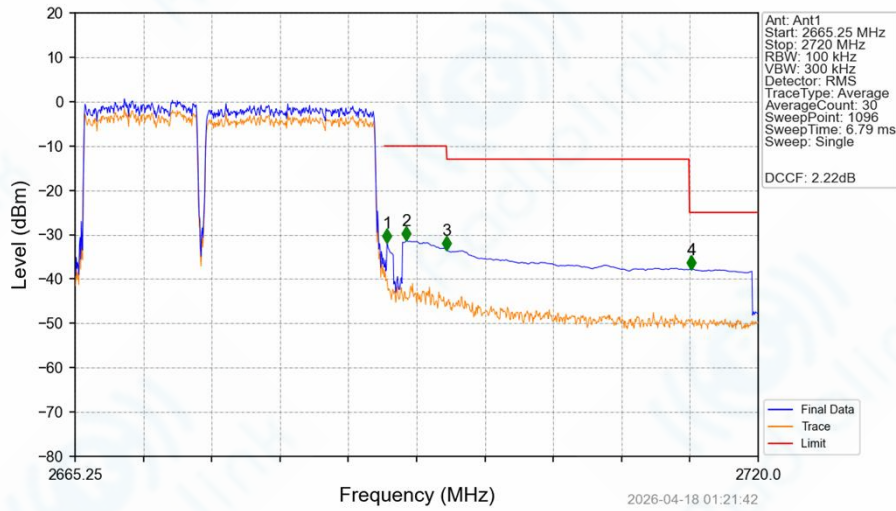

Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
2665.25	2690	0.1	/	/	/	/	/	/
2690	2691	0.489	CHP	1	2690.250	-31.91	-10	Pass
2691	2695	1	CHP	2	2691.800	-31.39	-10	Pass
2695	2714.458	1	CHP	3	2695.050	-33.58	-13	Pass
2714.458	2720	1	CHP	4	2714.650	-37.80	-25	Pass


CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:16QAM CC2:16QAM_CC1:2670.5 CC2:2682.5MHz_CC1: 50@0 CC2: 75@0

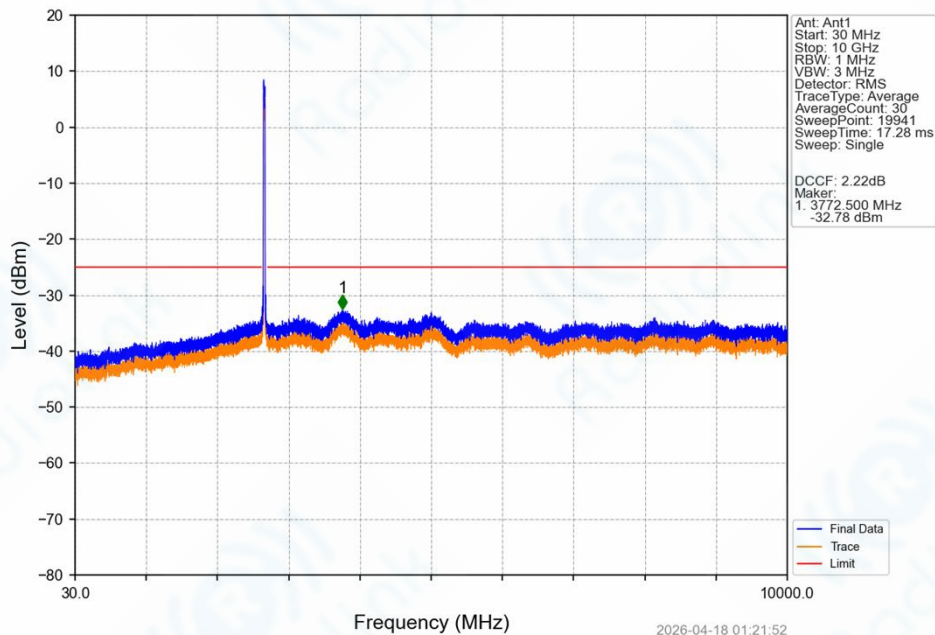


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:16QAM CC2:16QAM_CC1:2670.5 CC2:2682.5MHz_CC1: 50@0 CC2: 75@0

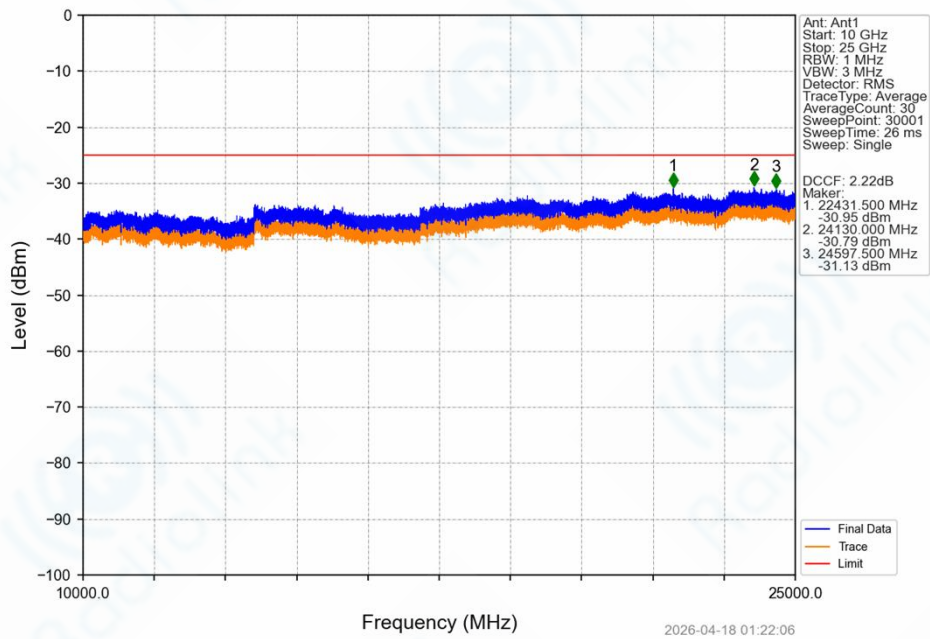


CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:16QAM CC2:16QAM_CC1:2670.5 CC2:2682.5MHz_CC1: 50@0 CC2: 75@0

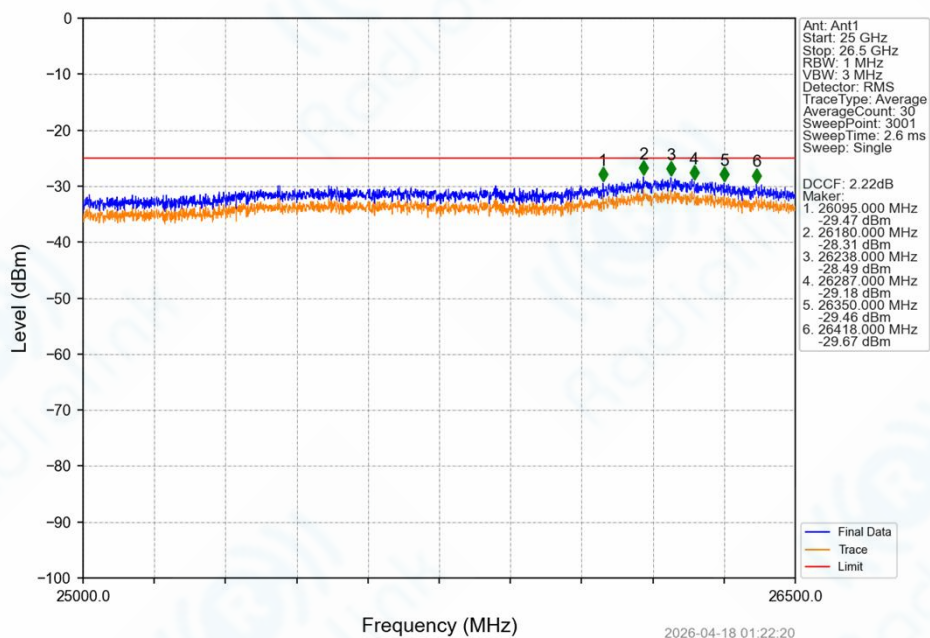


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:64QAM CC2:64QAM_CC1:2501 CC2:2513MHz_CC1: 1@0 CC2: 1@0

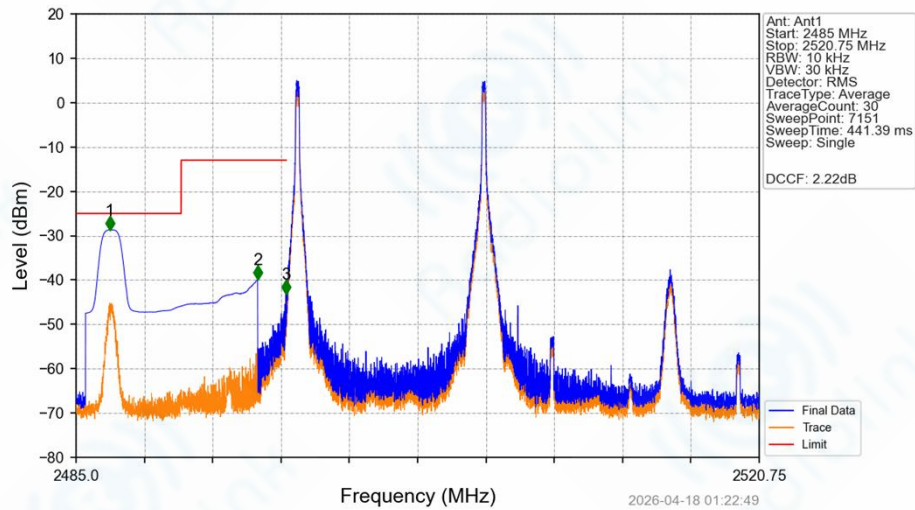

CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:64QAM CC2:64QAM_CC1:2501 CC2:2513MHz_CC1: 1@0 CC2: 1@0

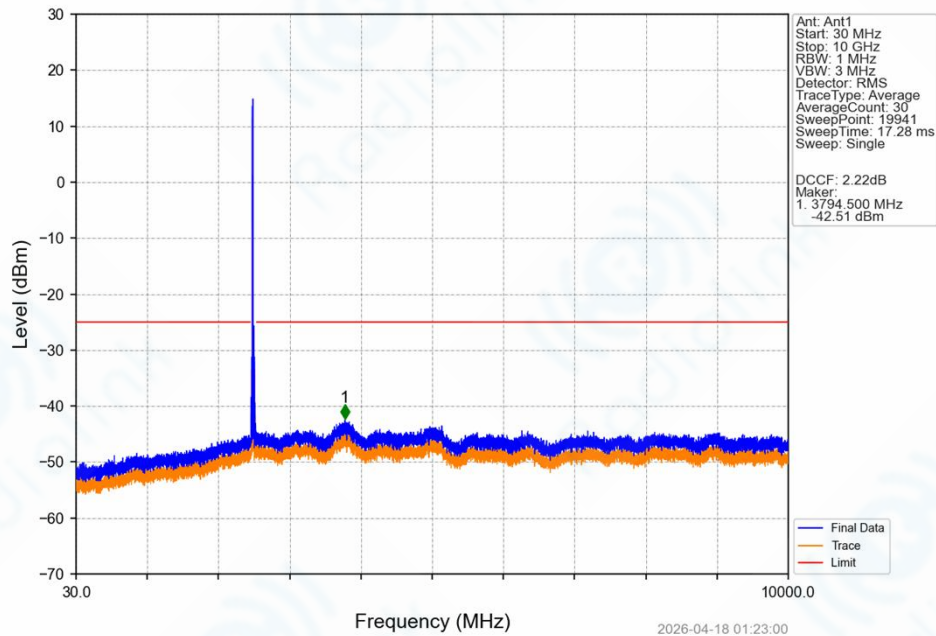


Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China

Tel: +86 0755 23080694


CA_41C_SISO_NTNV_CC1:10_CC2:15MHz_CC1:64QAM_CC2:64QAM_CC1:2501_CC2:2513MHz_CC1: 1@0_CC2: 1@0

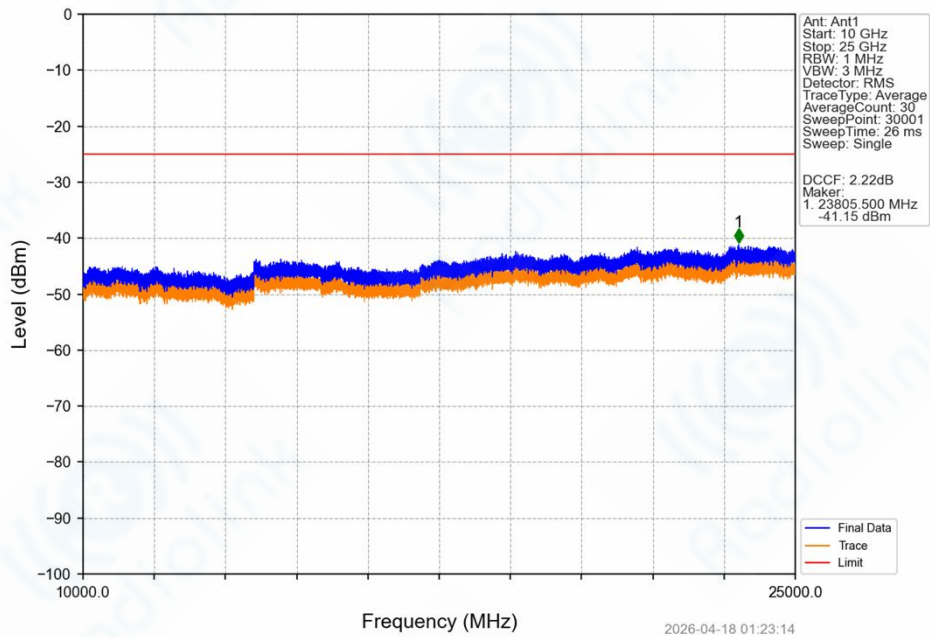


CA_41C_SISO_NTNV_CC1:10_CC2:15MHz_CC1:64QAM_CC2:64QAM_CC1:2501_CC2:2513MHz_CC1: 1@0_CC2: 1@0

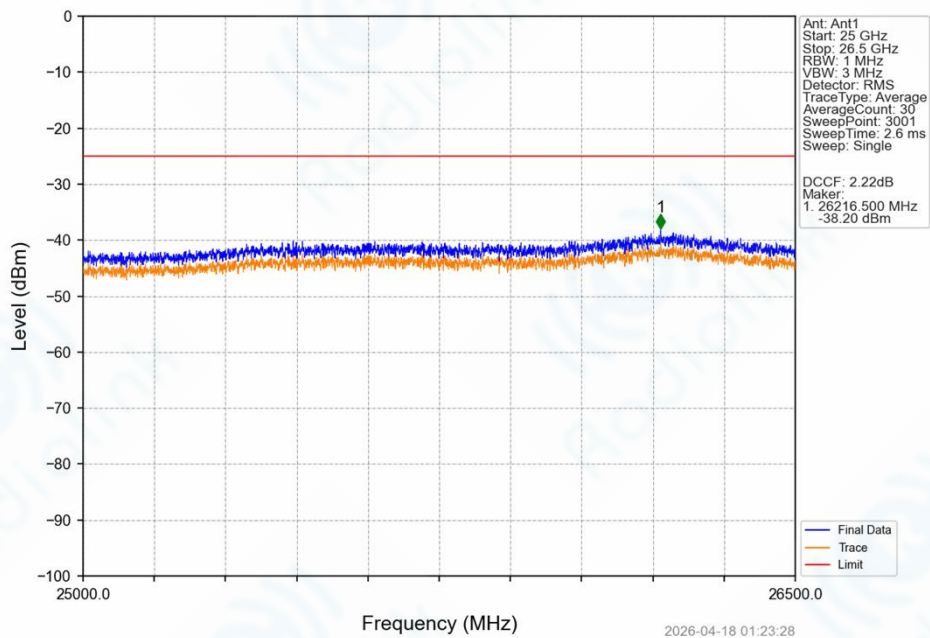

CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:64QAM CC2:64QAM_CC1:2501 CC2:2513MHz_CC1: 50@0 CC2: 75@0

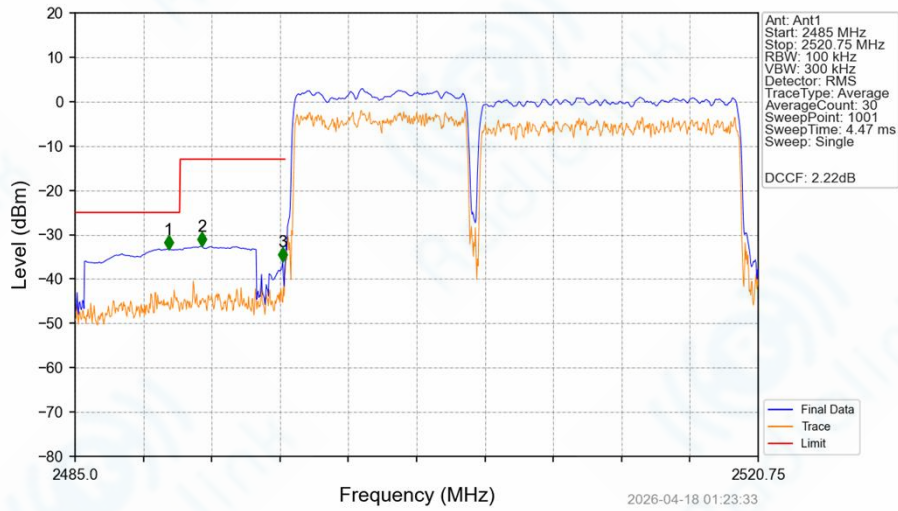


CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:64QAM CC2:64QAM_CC1:2501 CC2:2513MHz_CC1: 50@0 CC2: 75@0

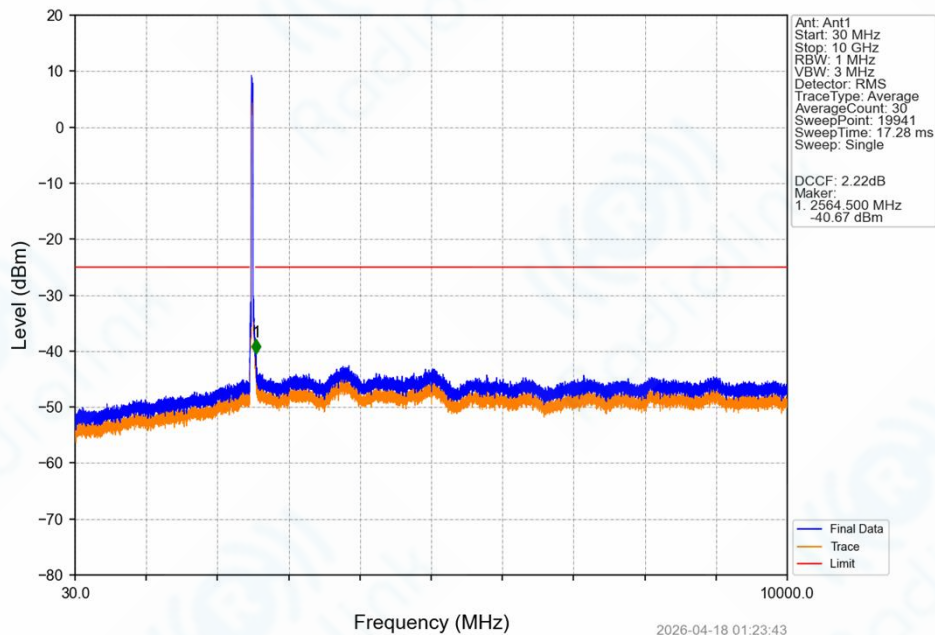


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:64QAM CC2:64QAM_CC1:2501 CC2:2513MHz_CC1: 50@0 CC2:
75@0

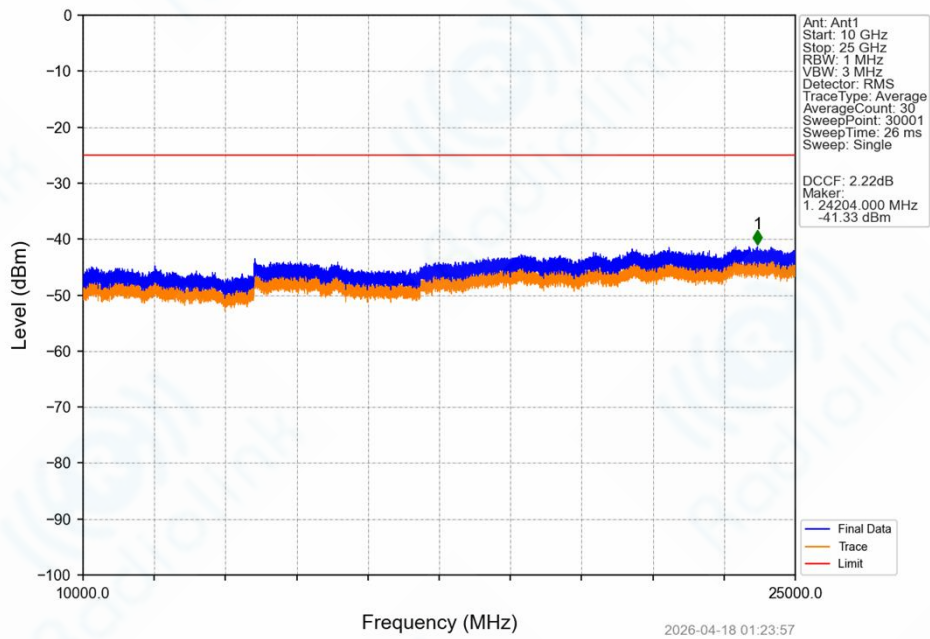


CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:64QAM CC2:64QAM_CC1:2501 CC2:2513MHz_CC1: 50@0 CC2:
75@0

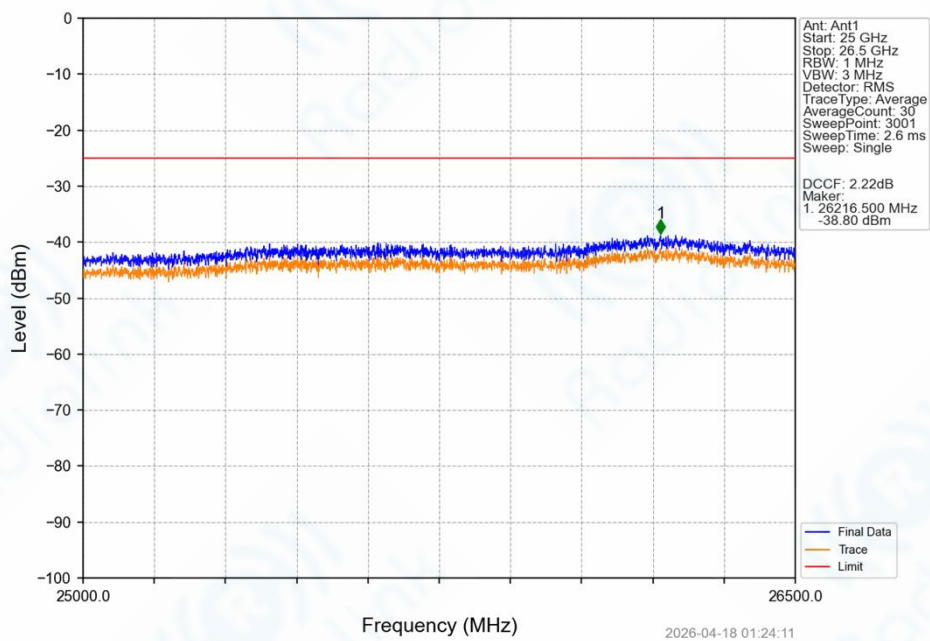


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694


CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:64QAM CC2:64QAM_CC1:2670.5 CC2:2682.5MHz_CC1: 1@0 CC2:
1@0

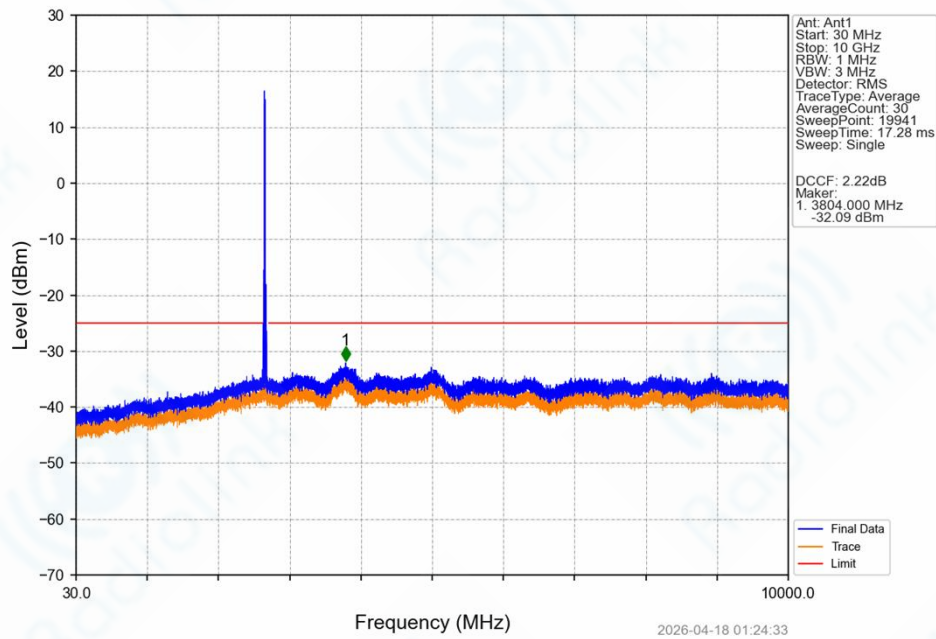


CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:64QAM CC2:64QAM_CC1:2670.5 CC2:2682.5MHz_CC1: 1@0 CC2:
1@0

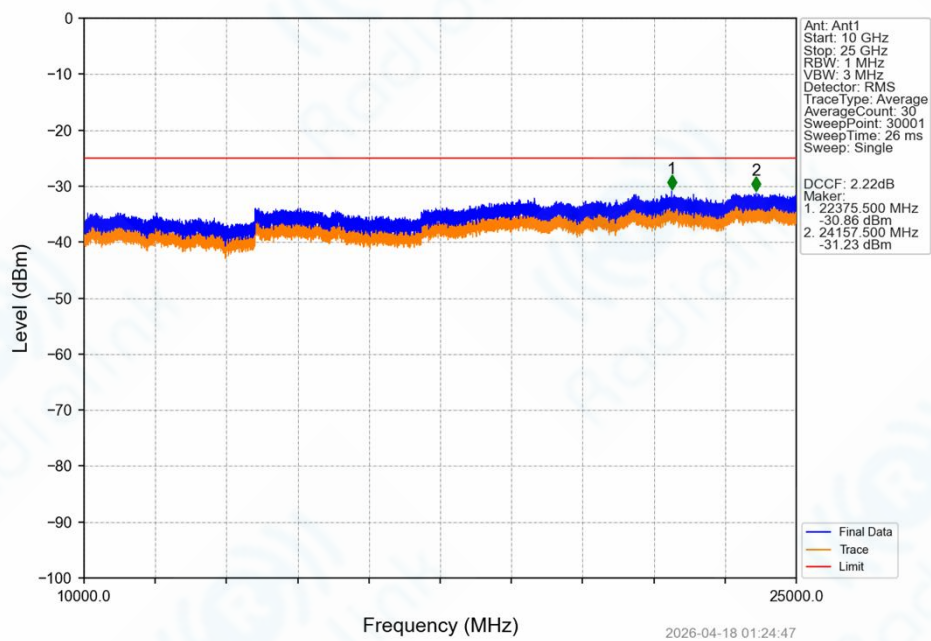

CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:64QAM CC2:64QAM_CC1:2670.5 CC2:2682.5MHz_CC1: 1@0 CC2: 1@0

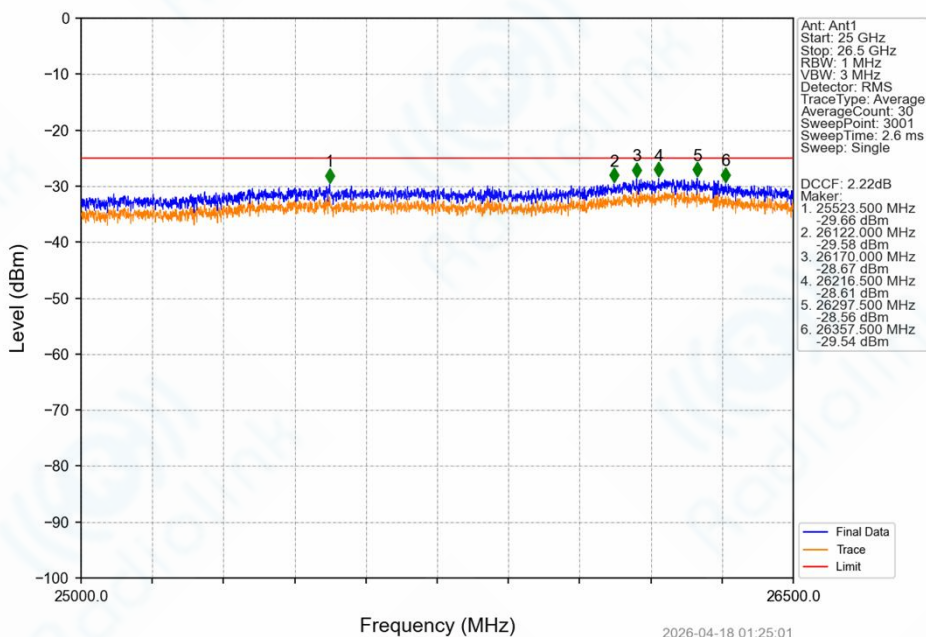

CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:64QAM CC2:64QAM_CC1:2670.5 CC2:2682.5MHz_CC1: 1@49 CC2: 1@74

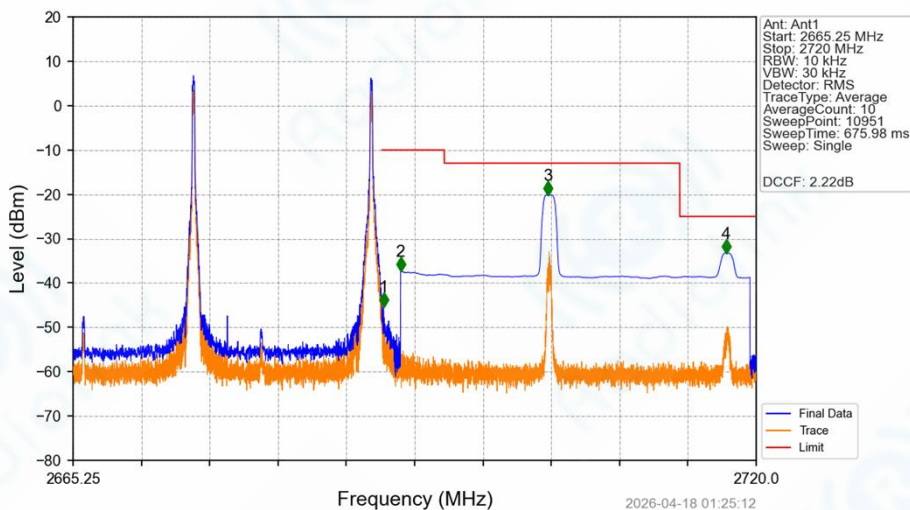


Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
2665.25	2690	0.02	CHP	/	/	/	/	/
2690	2691	0.02	CHP	1	2690.140	-45.27	-10	Pass
2691	2695	1	CHP	2	2691.500	-37.29	-10	Pass
2695	2713.87	1	CHP	3	2703.285	-20.18	-13	Pass
2713.87	2720	1	CHP	4	2717.580	-33.23	-25	Pass

Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:64QAM CC2:64QAM_CC1:2670.5 CC2:2682.5MHz_CC1: 50@0 CC2: 75@0

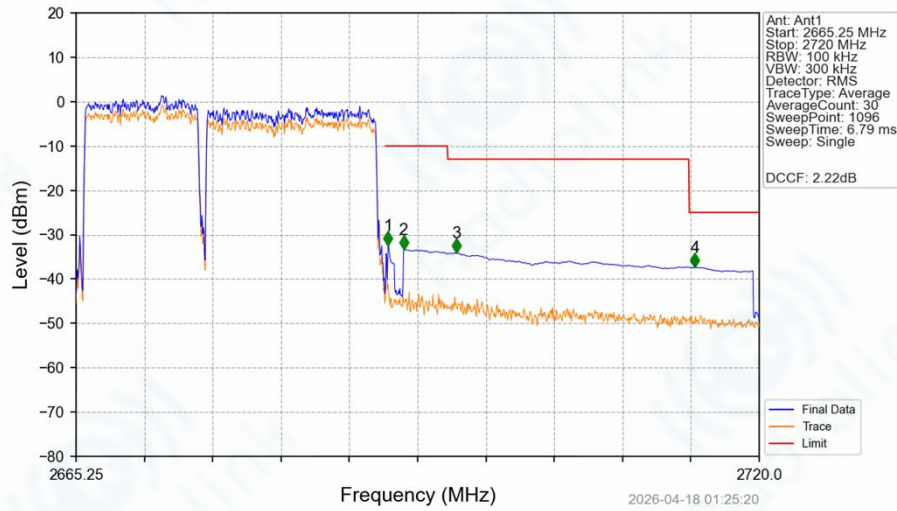

Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
2665.25	2690	0.1	/	/	/	/	/	/
2690	2691	0.488	CHP	1	2690.250	-32.32	-10	Pass
2691	2695	1	CHP	2	2691.500	-33.37	-10	Pass
2695	2714.398	1	CHP	3	2695.700	-34.12	-13	Pass
2714.398	2720	1	CHP	4	2714.850	-37.37	-25	Pass


CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:64QAM CC2:64QAM_CC1:2670.5 CC2:2682.5MHz_CC1: 50@0 CC2: 75@0

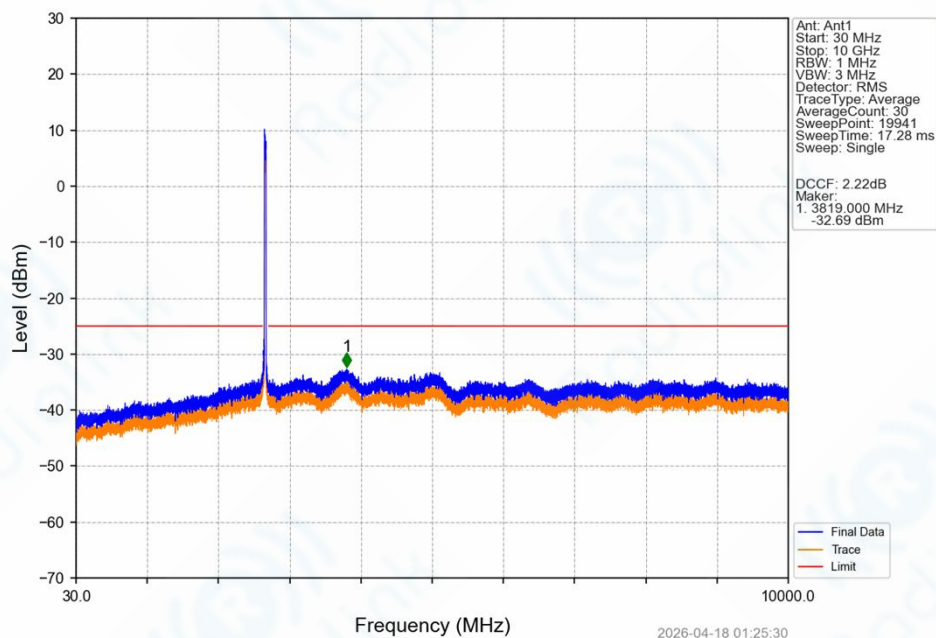


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694


CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:64QAM CC2:64QAM_CC1:2670.5 CC2:2682.5MHz_CC1: 50@0 CC2:
75@0

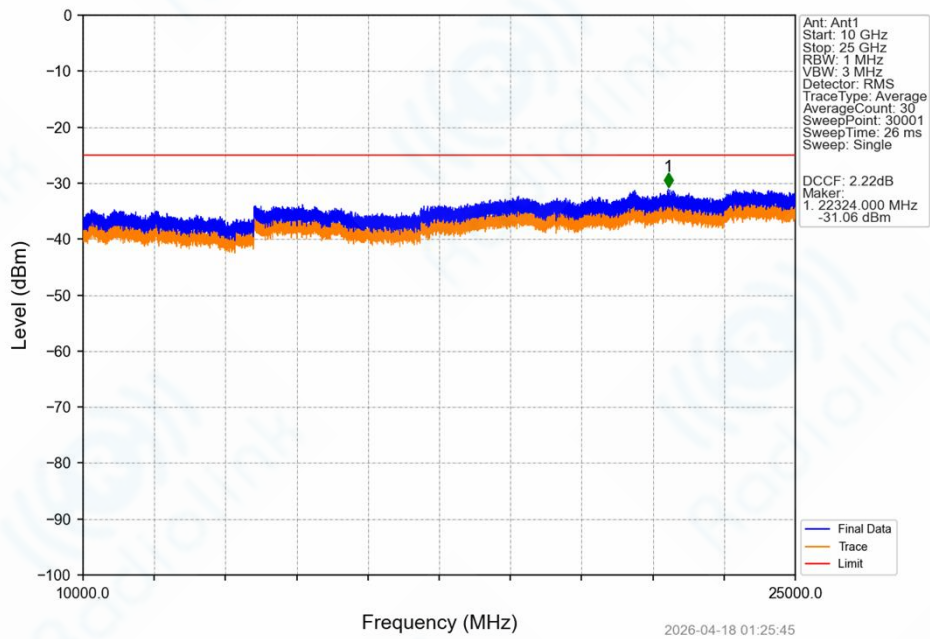

CA_41C_SISO_NTNV_CC1:10 CC2:15MHz_CC1:64QAM CC2:64QAM_CC1:2670.5 CC2:2682.5MHz_CC1: 50@0 CC2:
75@0

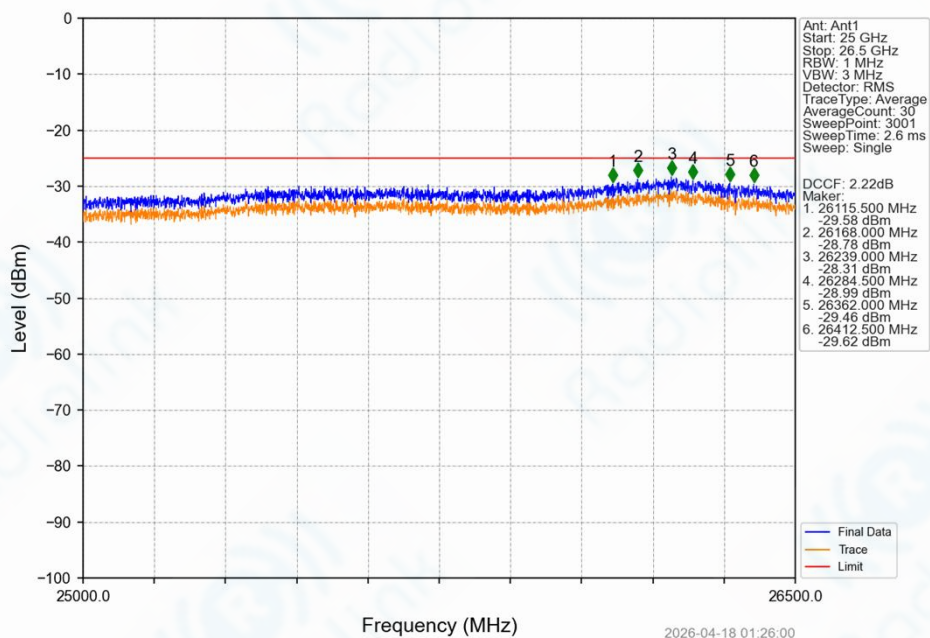


CA_41C_SISO_NTNV_CC1:10_CC2:20MHz_CC1:QPSK_CC2:QPSK_CC1:2501_CC2:2515.4MHz_CC1: 1@0 CC2: 1@0

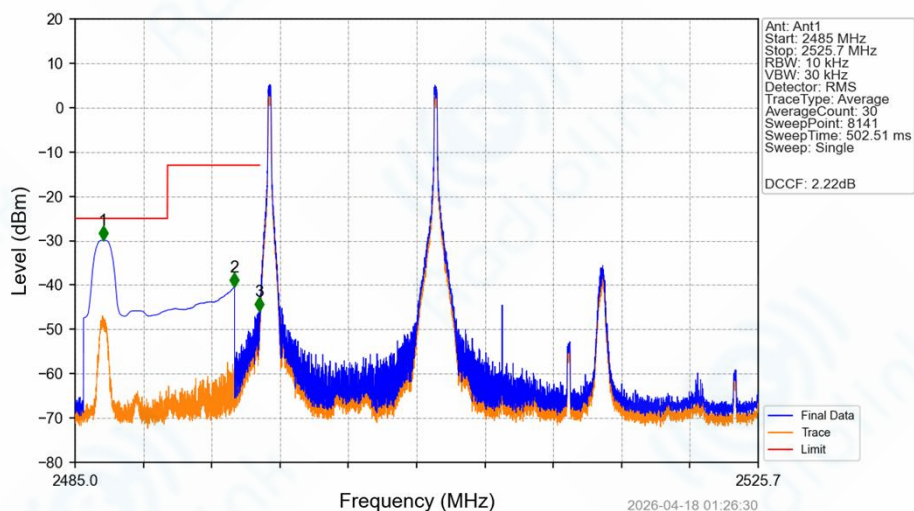

Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
2485	2490.5	1	CHP	1	2486.680	-29.90	-25	Pass
2490.5	2495	1	CHP	2	2494.495	-40.41	-13	Pass
2495	2496	0.01	/	3	2495.980	-45.84	-13	Pass
2496	2525.7	0.01	/	/	/	/	/	/


CA_41C_SISO_NTNV_CC1:10_CC2:20MHz_CC1:QPSK_CC2:QPSK_CC1:2501_CC2:2515.4MHz_CC1: 1@0 CC2: 1@0

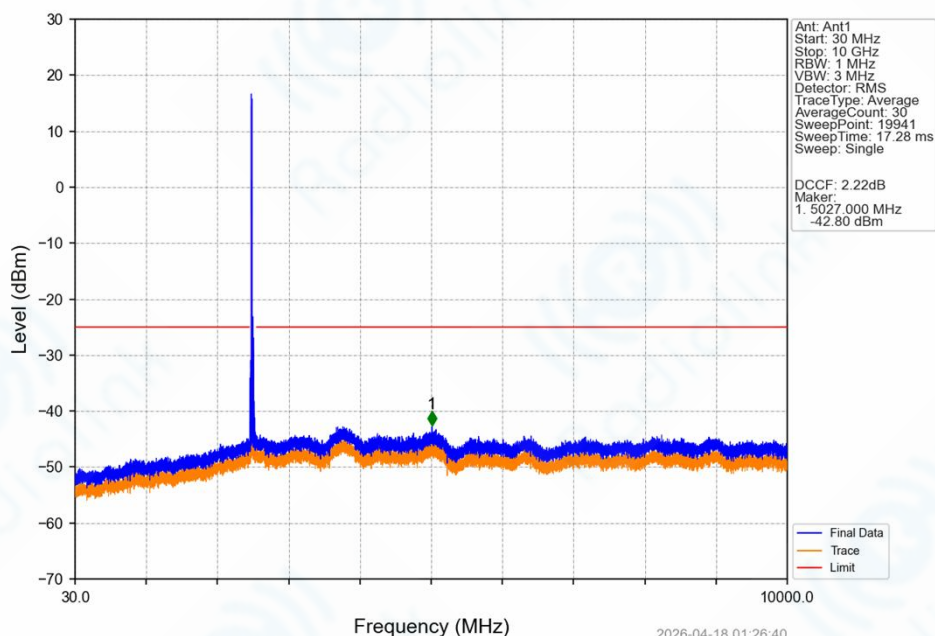


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10_CC2:20MHz_CC1:QPSK_CC2:QPSK_CC1:2501_CC2:2515.4MHz_CC1: 1@0 CC2: 1@0

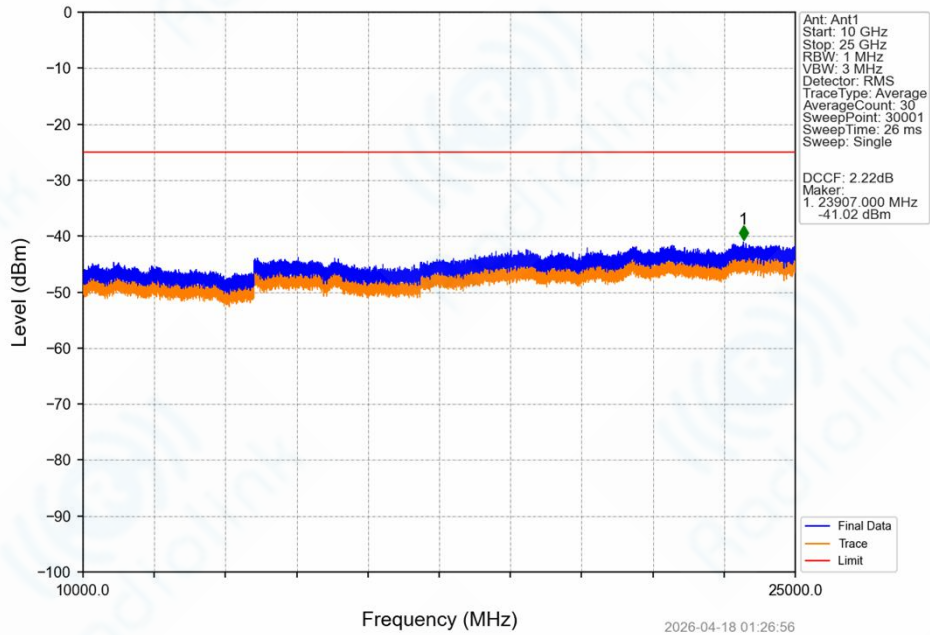

CA_41C_SISO_NTNV_CC1:10_CC2:20MHz_CC1:QPSK_CC2:QPSK_CC1:2501_CC2:2515.4MHz_CC1: 1@0 CC2: 1@0

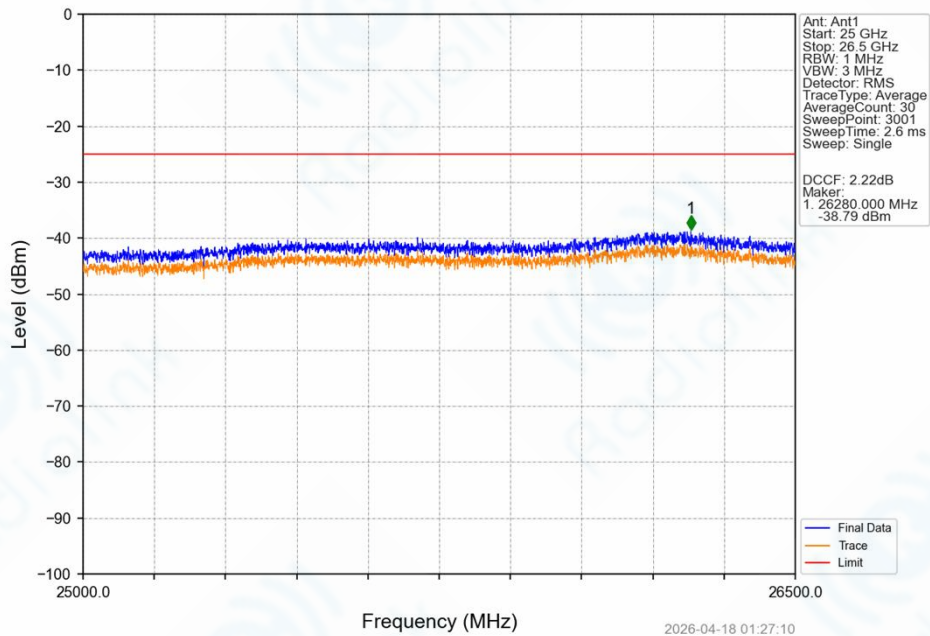


Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China

Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:QPSK CC2:QPSK_CC1:2501 CC2:2515.4MHz_CC1: 50@0 CC2: 100@0

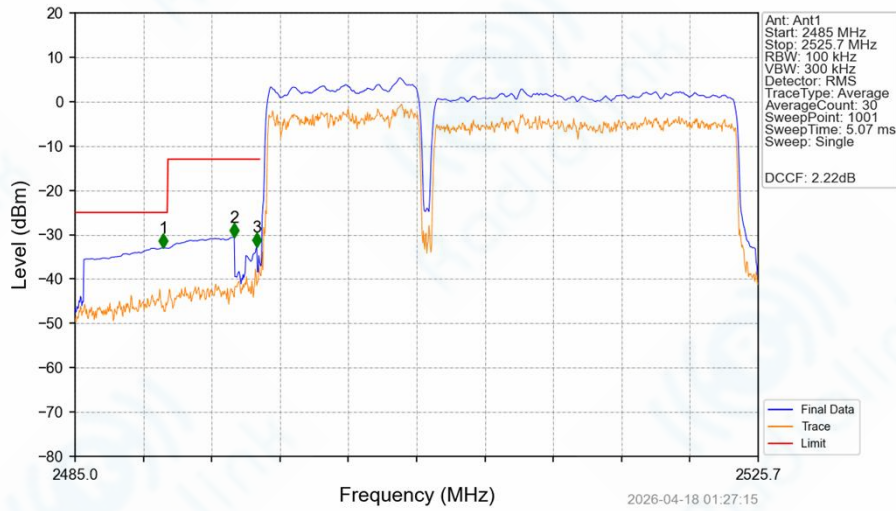


CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:QPSK CC2:QPSK_CC1:2501 CC2:2515.4MHz_CC1: 50@0 CC2: 100@0

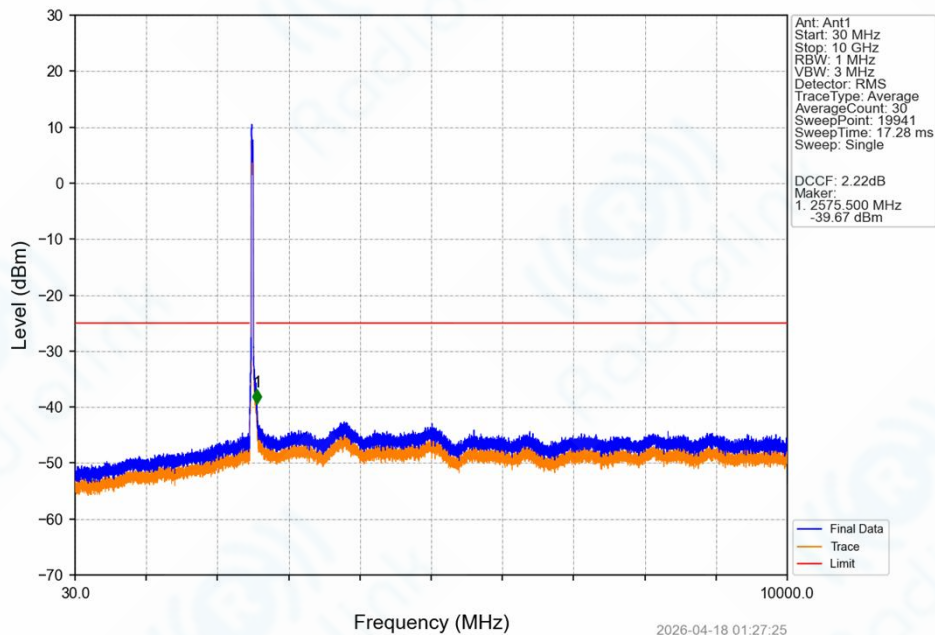


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:QPSK CC2:QPSK_CC1:2501 CC2:2515.4MHz_CC1: 50@0 CC2:
100@0

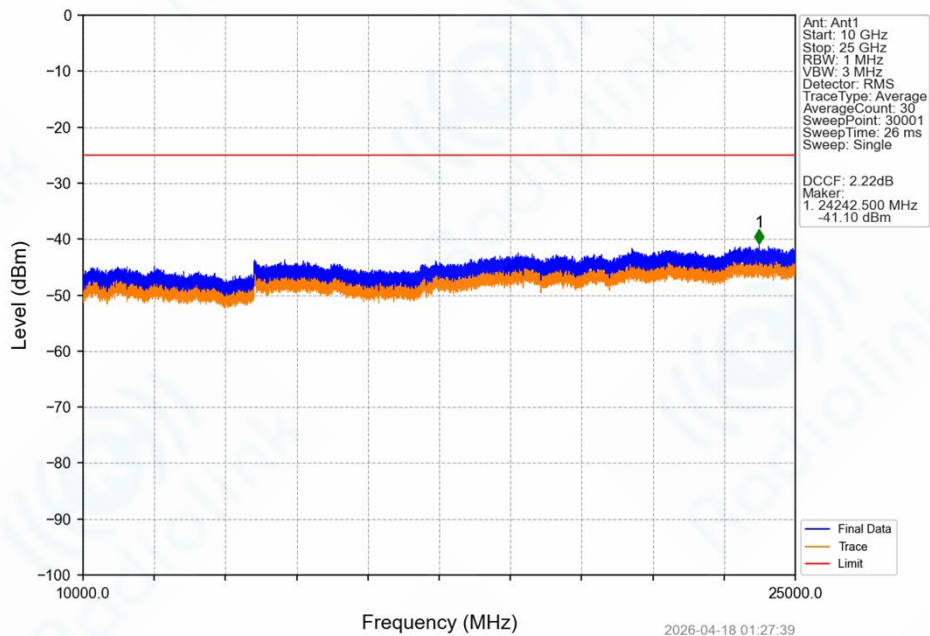


CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:QPSK CC2:QPSK_CC1:2501 CC2:2515.4MHz_CC1: 50@0 CC2:
100@0

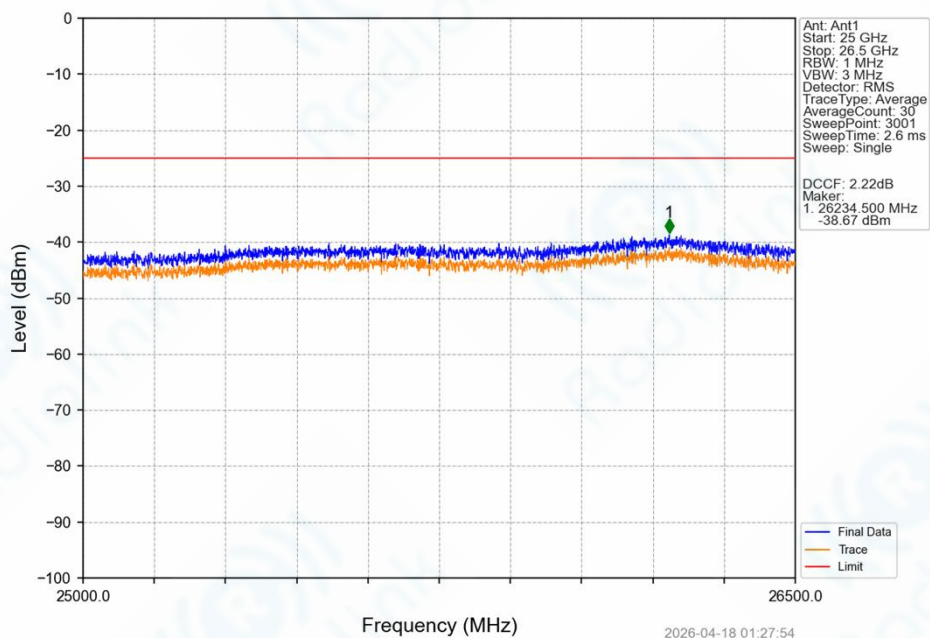


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10_CC2:20MHz_CC1:QPSK_CC2:QPSK_CC1:2665.6_CC2:2680MHz_CC1: 1@0 CC2: 1@0

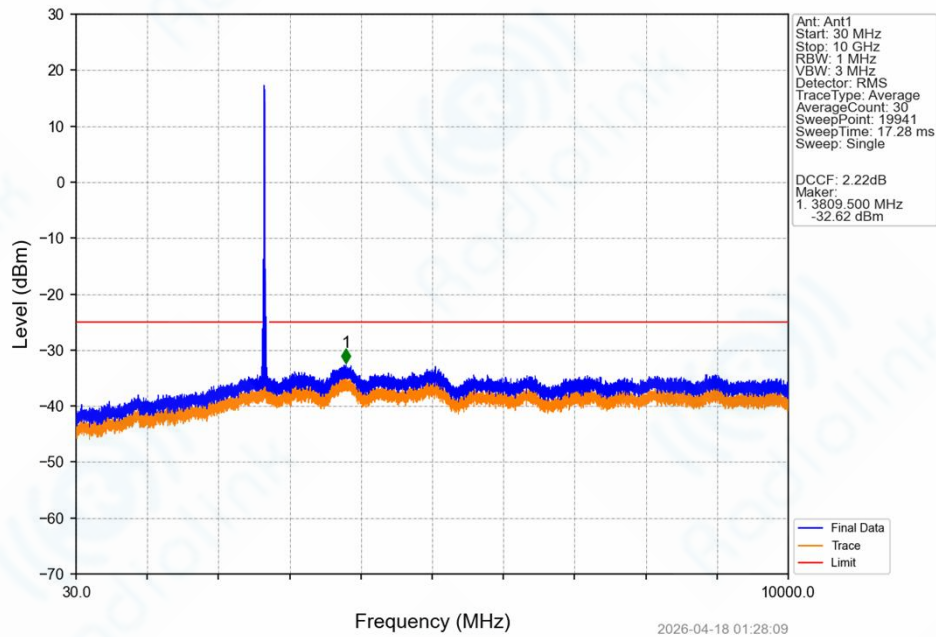

CA_41C_SISO_NTNV_CC1:10_CC2:20MHz_CC1:QPSK_CC2:QPSK_CC1:2665.6_CC2:2680MHz_CC1: 1@0 CC2: 1@0

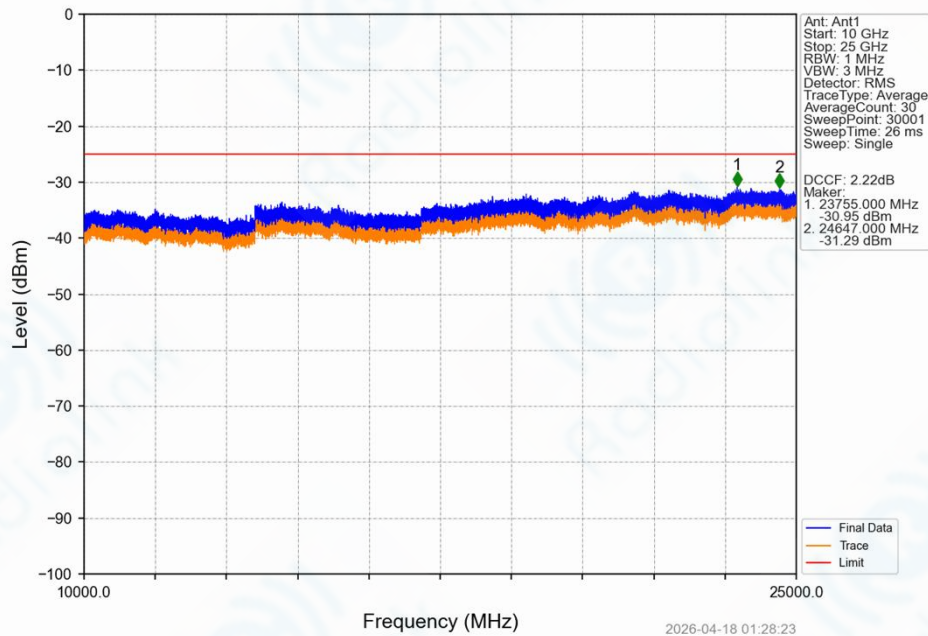


Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China

Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:QPSK CC2:QPSK CC1:2665.6 CC2:2680MHz CC1: 1@0 CC2: 1@0

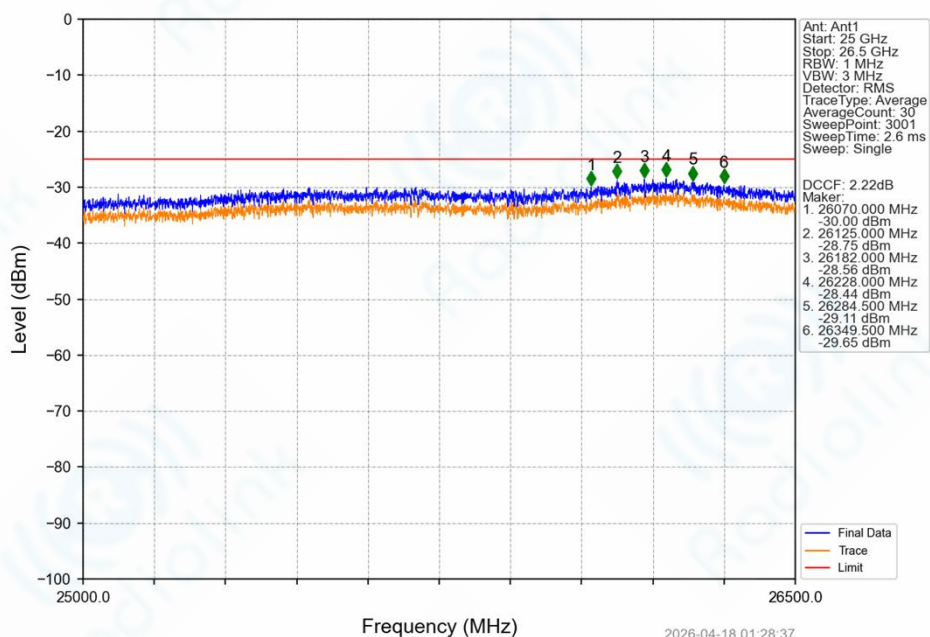

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:QPSK CC2:QPSK_CC1:2665.6 CC2:2680MHz_CC1: 1@49 CC2: 1@99

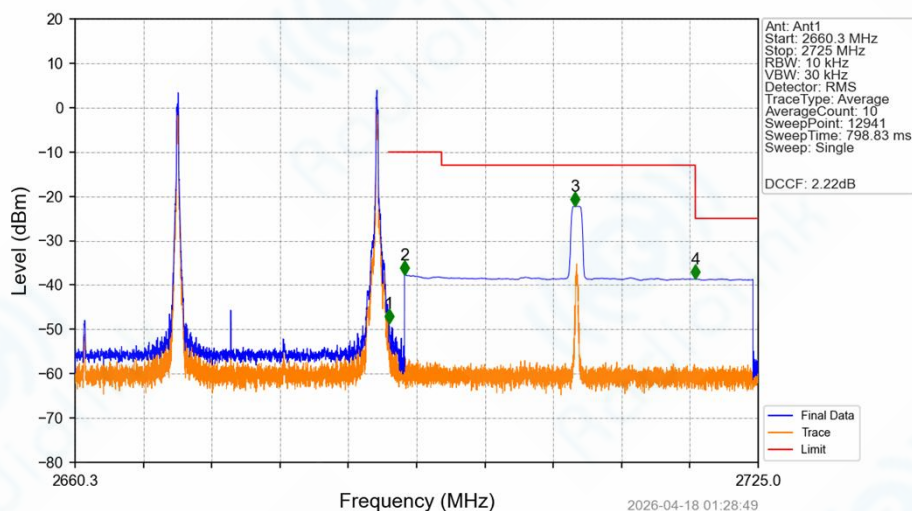


Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
2660.3	2690	0.02	CHP	/	/	/	/	/
2690	2691	0.02	CHP	1	2690.025	-48.55	-10	Pass
2691	2695	1	CHP	2	2691.510	-37.64	-10	Pass
2695	2719.041	1	CHP	3	2707.620	-22.25	-13	Pass
2719.041	2725	1	CHP	4	2719.055	-38.61	-25	Pass


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:QPSK CC2:QPSK_CC1:2665.6 CC2:2680MHz_CC1: 50@0 CC2: 100@0

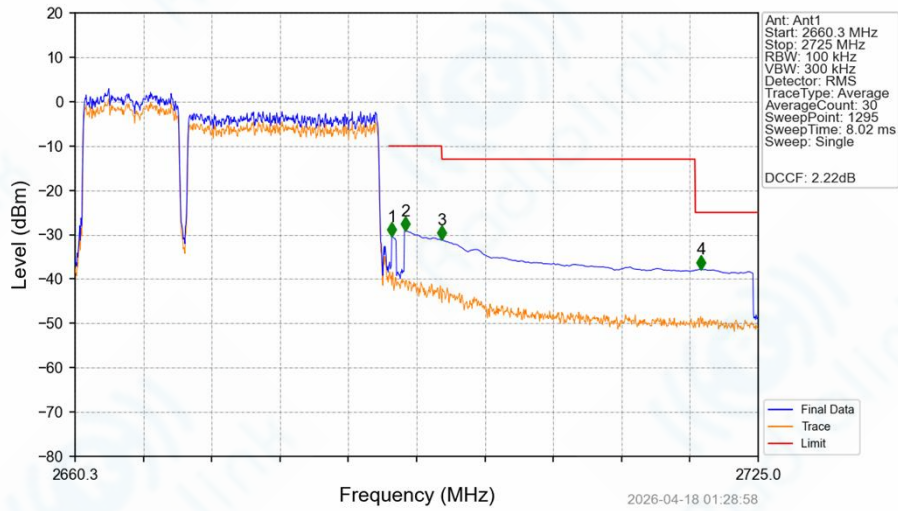


CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:QPSK CC2:QPSK_CC1:2665.6 CC2:2680MHz_CC1: 50@0 CC2: 100@0

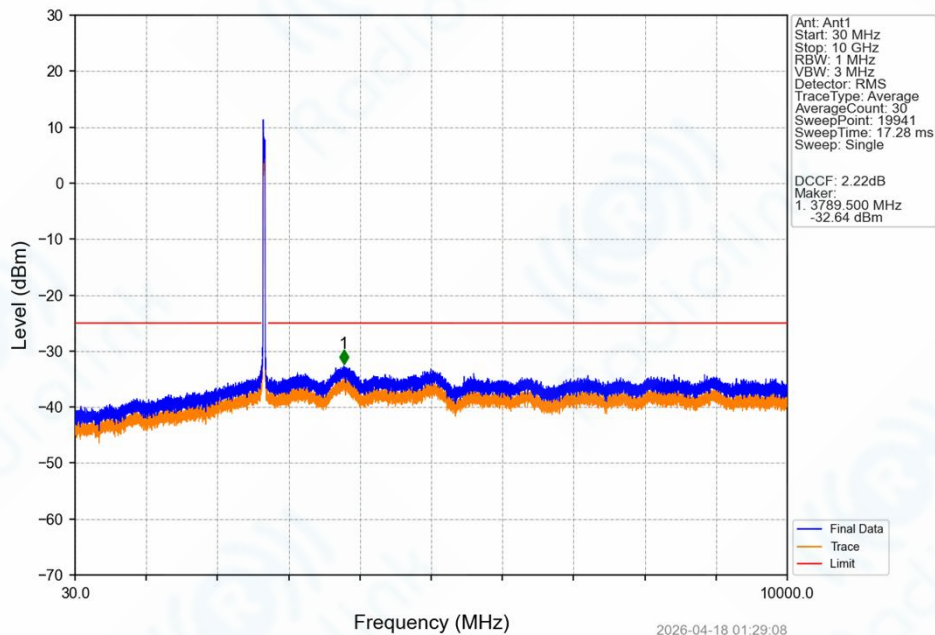


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:QPSK CC2:QPSK_CC1:2665.6 CC2:2680MHz_CC1: 50@0 CC2: 100@0

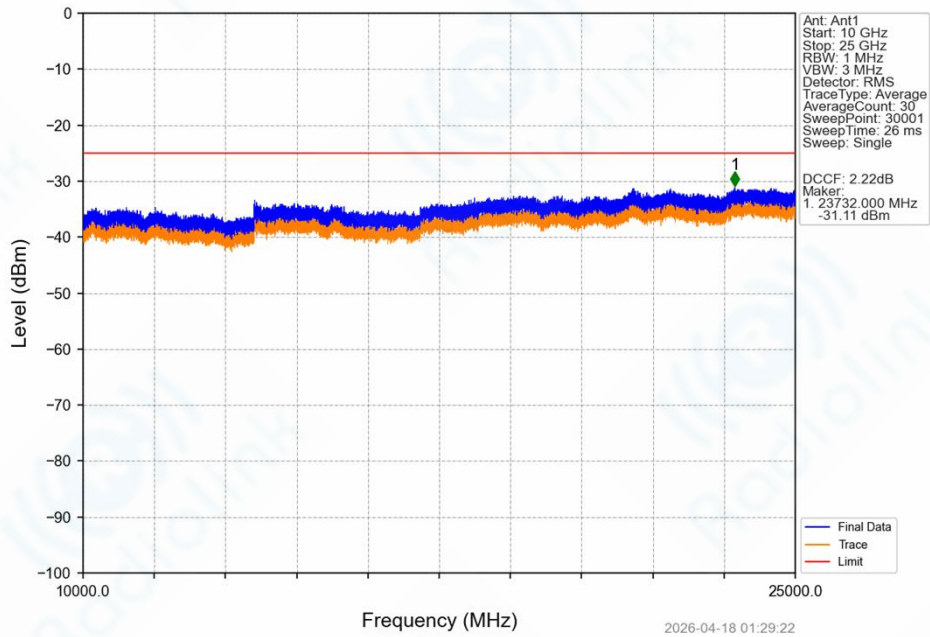

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:QPSK CC2:QPSK_CC1:2665.6 CC2:2680MHz_CC1: 50@0 CC2: 100@0

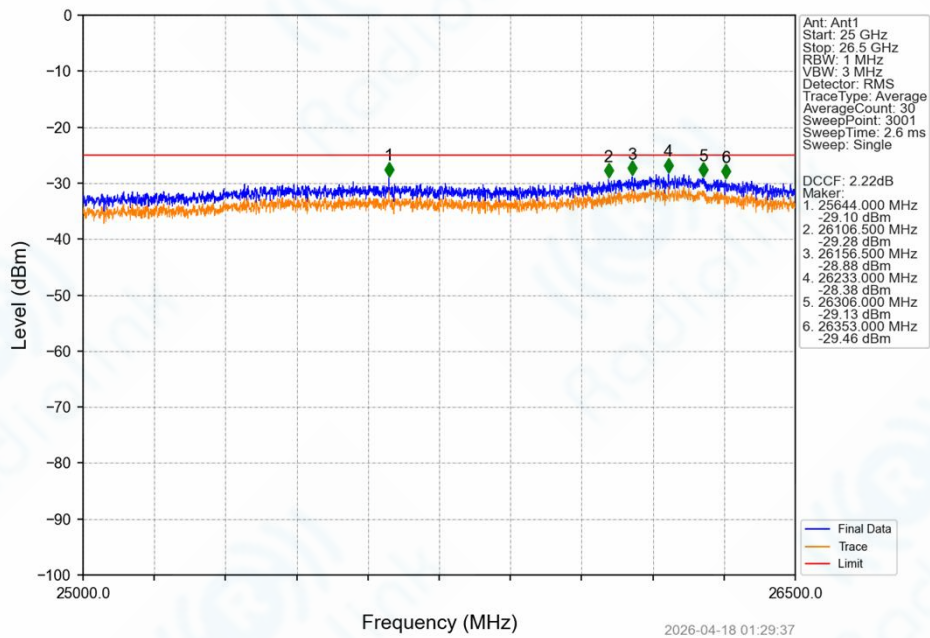


Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China

Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:16QAM CC2:16QAM_CC1:2501 CC2:2515.4MHz_CC1: 1@0 CC2:
1@0

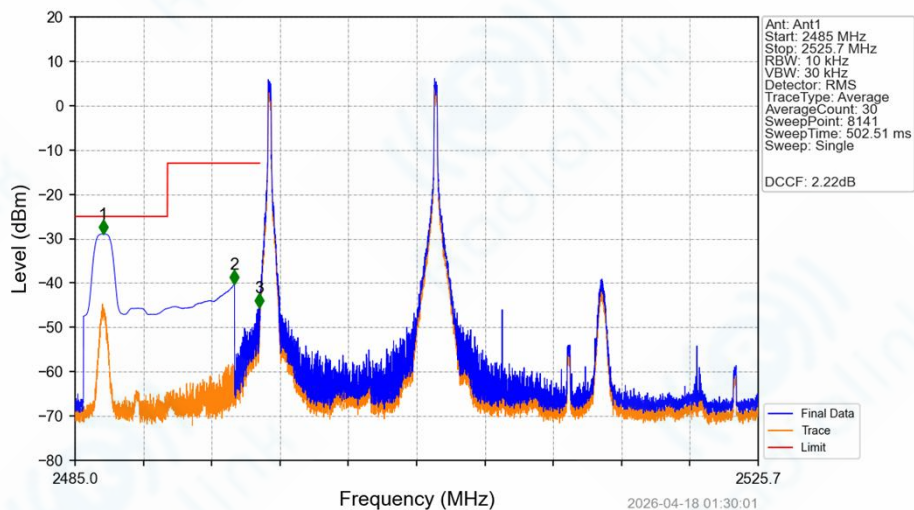


CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:16QAM CC2:16QAM_CC1:2501 CC2:2515.4MHz_CC1: 1@0 CC2:
1@0

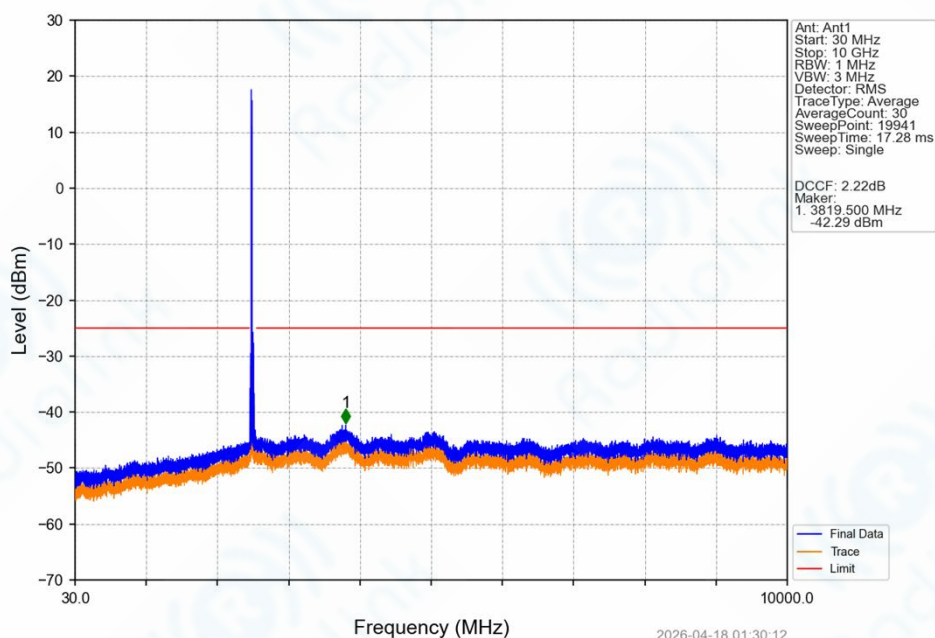


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:16QAM CC2:16QAM_CC1:2501 CC2:2515.4MHz_CC1: 1@0 CC2:
1@0

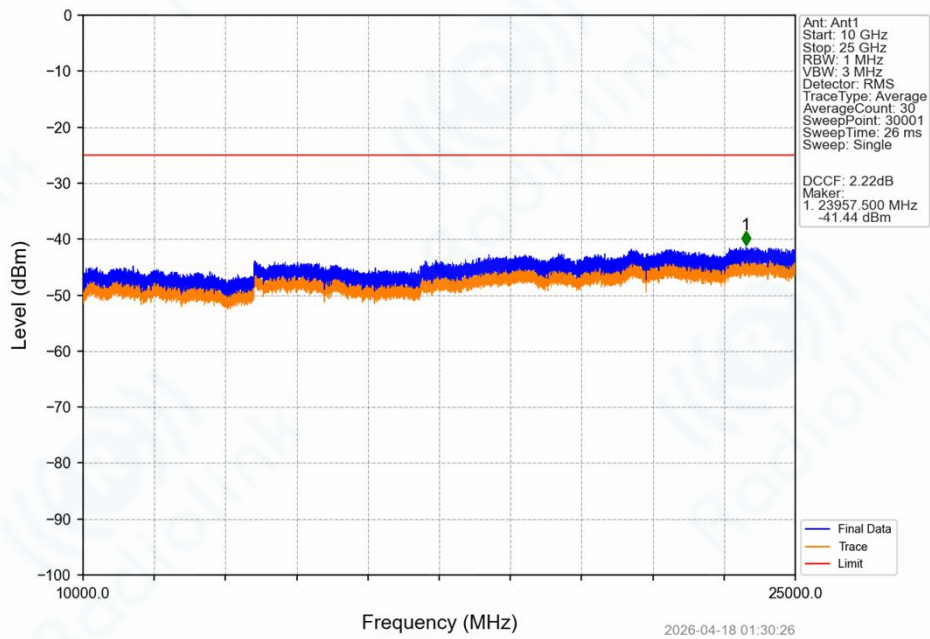


CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:16QAM CC2:16QAM_CC1:2501 CC2:2515.4MHz_CC1: 1@0 CC2:
1@0

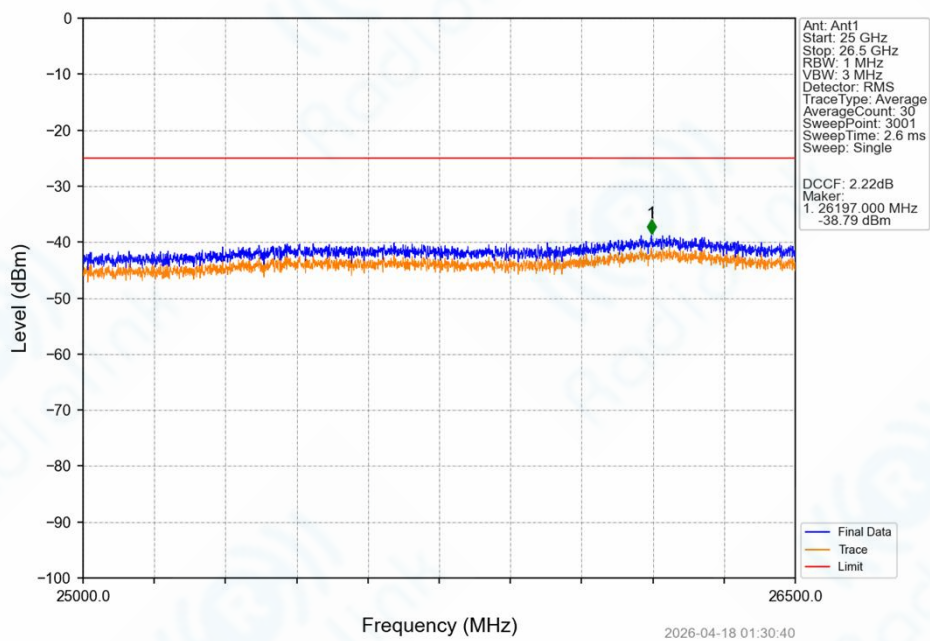

Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:16QAM CC2:16QAM_CC1:2501 CC2:2515.4MHz_CC1: 50@0 CC2: 100@0

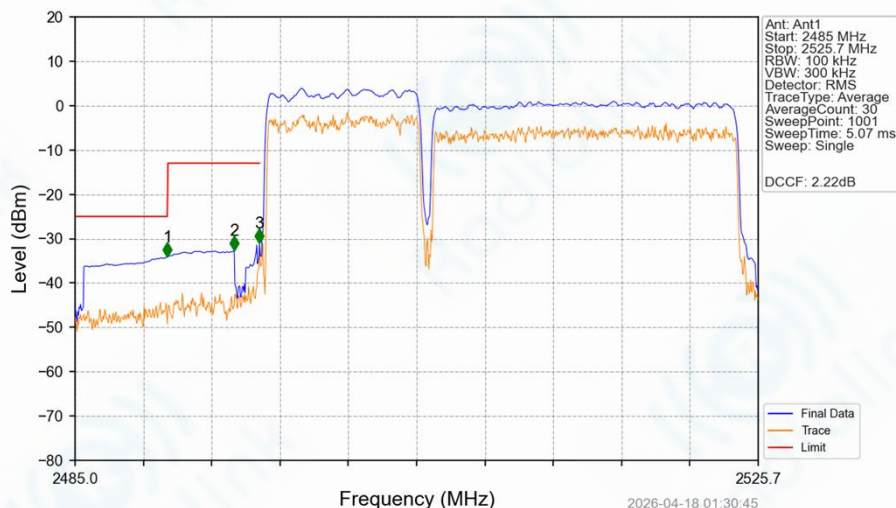

Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
2485	2490.5	1	CHP	1	2490.494	-34.05	-25	Pass
2490.5	2495	1	CHP	2	2494.483	-32.66	-13	Pass
2495	2496	0.289	CHP	3	2495.989	-30.96	-13	Pass
2496	2525.7	0.289	CHP	/	/	/	/	/


CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:16QAM CC2:16QAM_CC1:2501 CC2:2515.4MHz_CC1: 50@0 CC2: 100@0

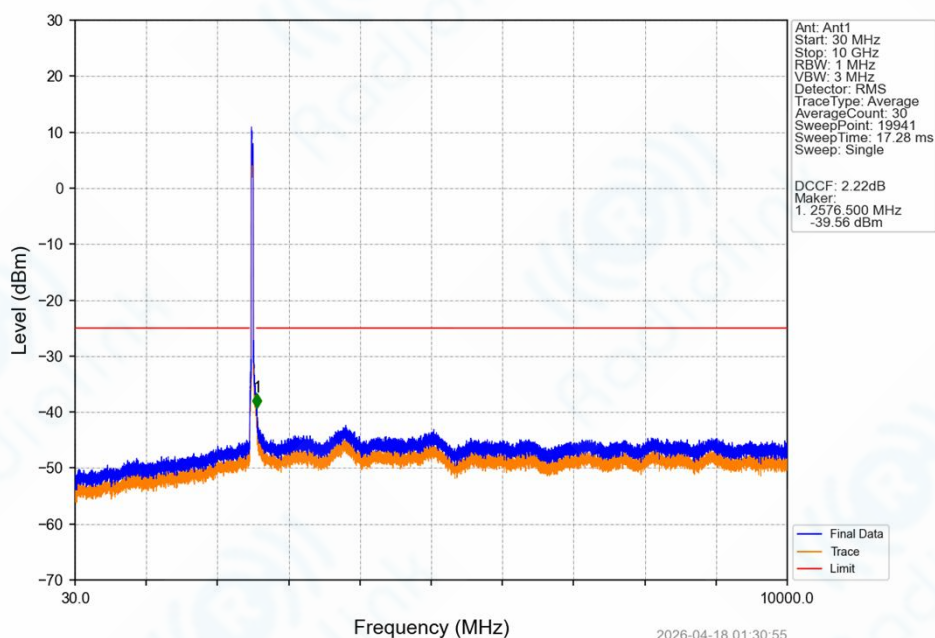


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694


CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:16QAM CC2:16QAM_CC1:2501 CC2:2515.4MHz_CC1: 50@0 CC2: 100@0

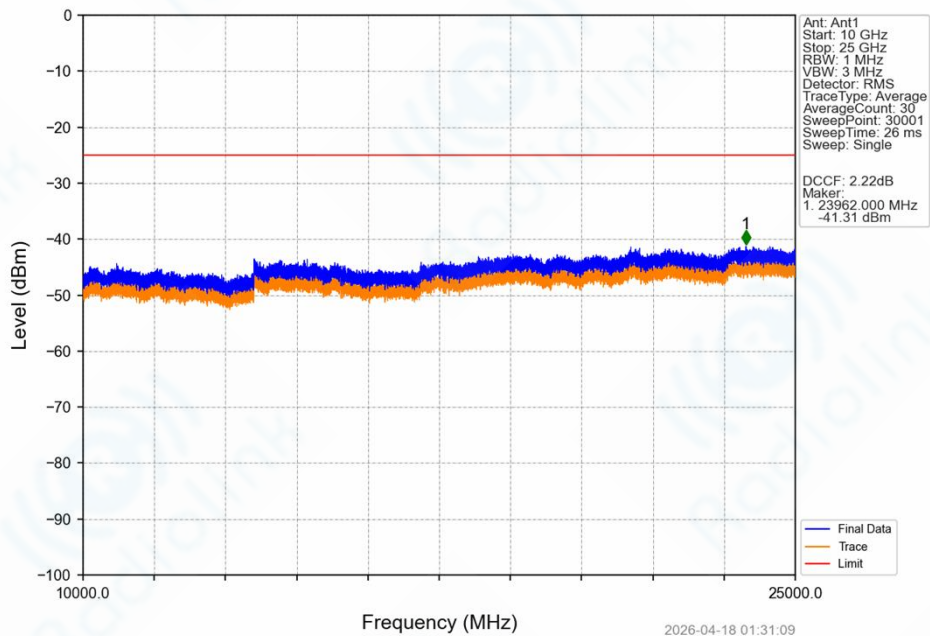


CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:16QAM CC2:16QAM_CC1:2501 CC2:2515.4MHz_CC1: 50@0 CC2: 100@0

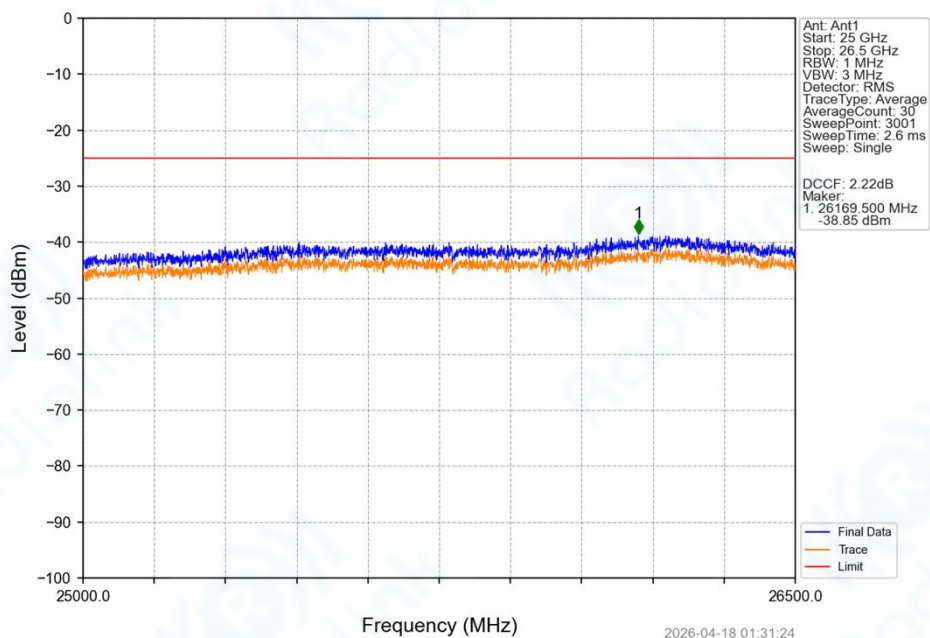

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:16QAM CC2:16QAM_CC1:2665.6 CC2:2680MHz_CC1: 1@0 CC2:
1@0

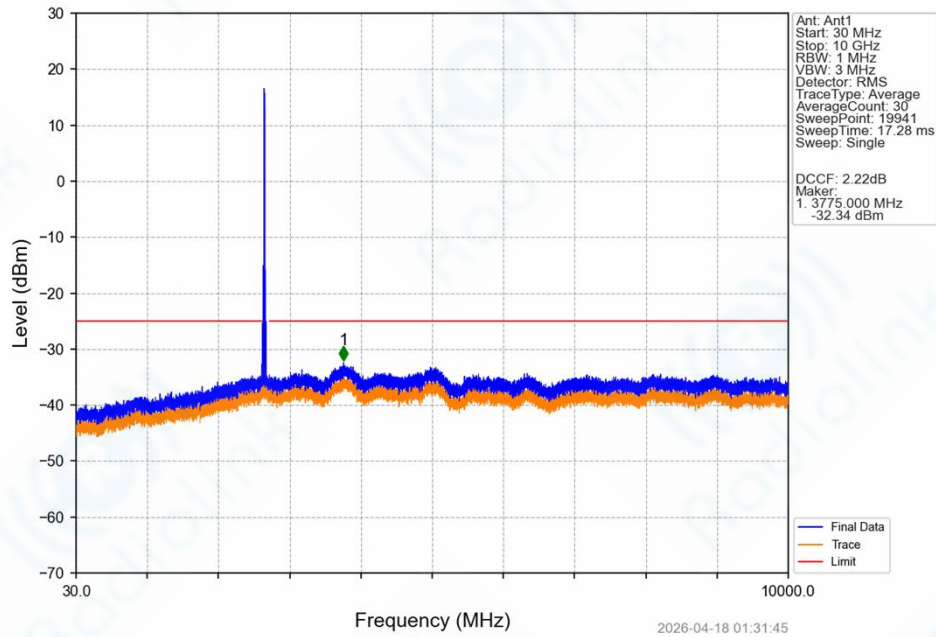

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:16QAM CC2:16QAM_CC1:2665.6 CC2:2680MHz_CC1: 1@0 CC2:
1@0

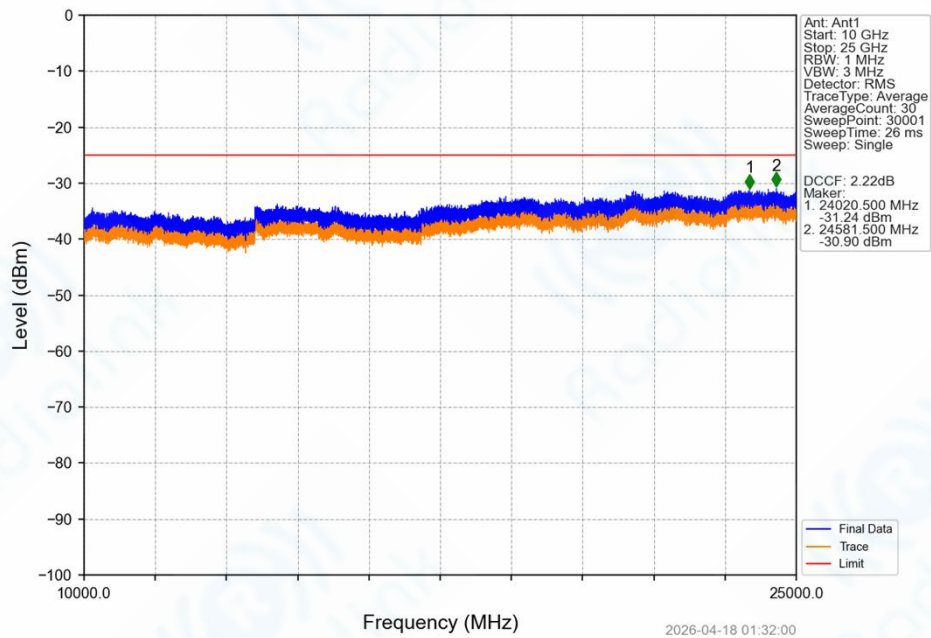


Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China

Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:16QAM CC2:16QAM_CC1:2665.6 CC2:2680MHz_CC1: 1@0 CC2: 1@0

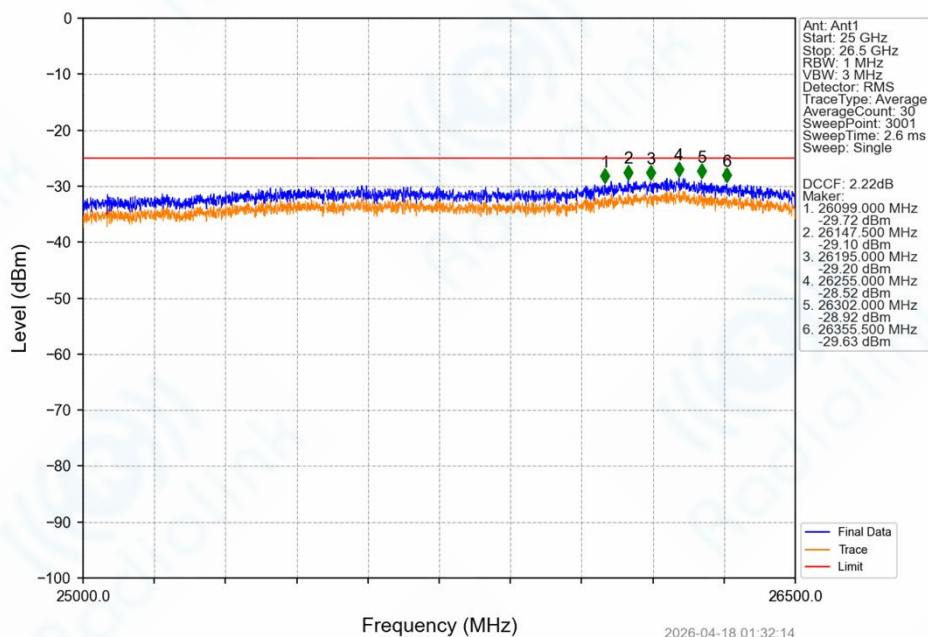

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:16QAM CC2:16QAM_CC1:2665.6 CC2:2680MHz_CC1: 1@49 CC2: 1@99

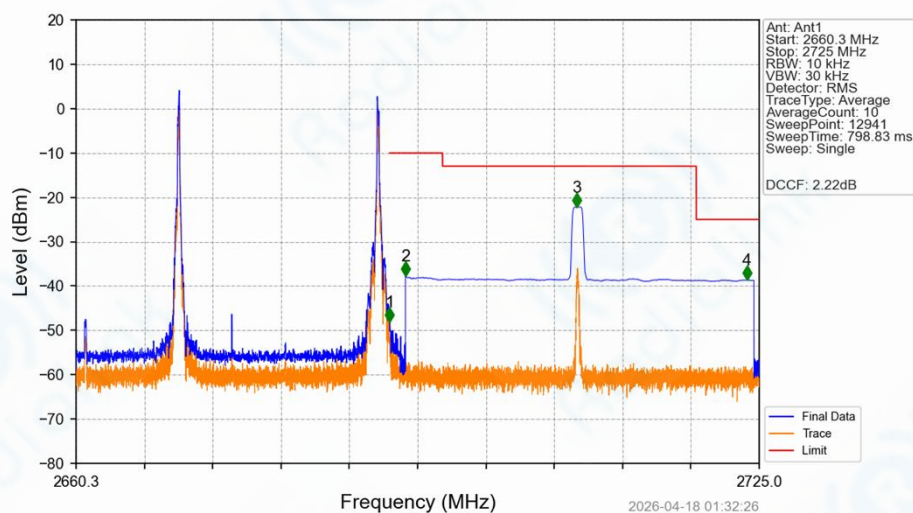


Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
2660.3	2690	0.02	CHP	/	/	/	/	/
2690	2691	0.02	CHP	1	2690.010	-48.14	-10	Pass
2691	2695	1	CHP	2	2691.500	-37.71	-10	Pass
2695	2719.038	1	CHP	3	2707.715	-22.21	-13	Pass
2719.038	2725	1	CHP	4	2723.850	-38.61	-25	Pass

Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:16QAM CC2:16QAM_CC1:2665.6 CC2:2680MHz_CC1: 50@0 CC2: 100@0

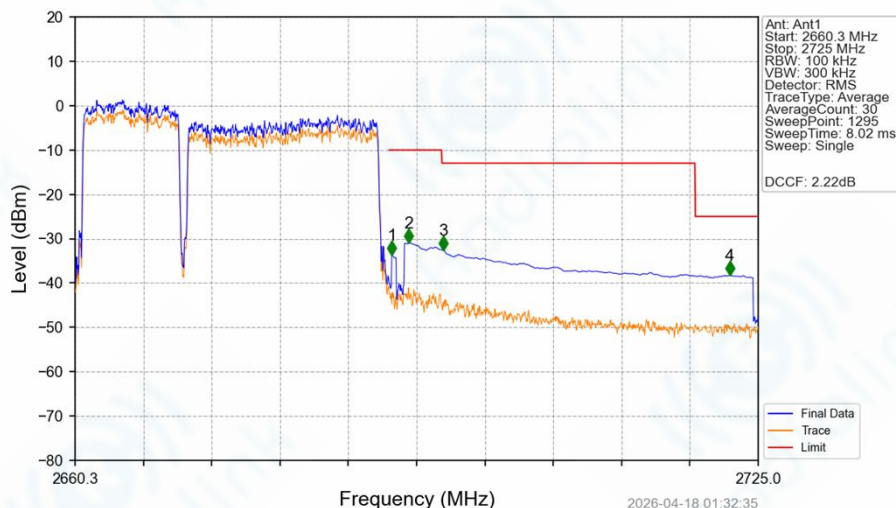


Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
2660.3	2690	0.1	/	1	/	/	/	/
2690	2691	0.581	CHP	1	2690.300	-33.76	-10	Pass
2691	2695	1	CHP	2	2691.900	-30.96	-10	Pass
2695	2719.038	1	CHP	3	2695.150	-32.53	-13	Pass
2719.038	2725	1	CHP	4	2722.300	-38.27	-25	Pass


CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:16QAM CC2:16QAM_CC1:2665.6 CC2:2680MHz_CC1: 50@0 CC2: 100@0

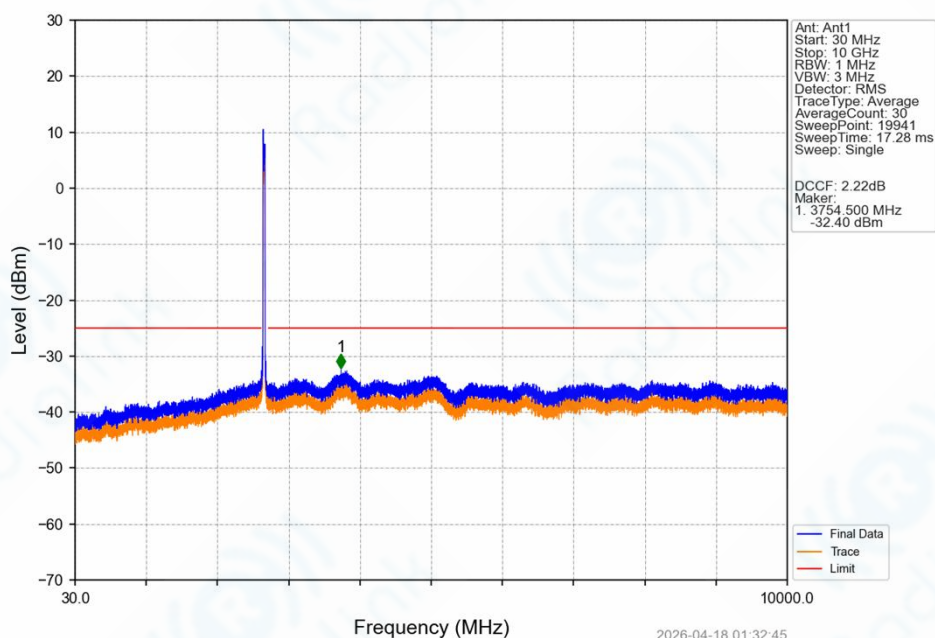

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:16QAM CC2:16QAM_CC1:2665.6 CC2:2680MHz_CC1: 50@0 CC2:
100@0

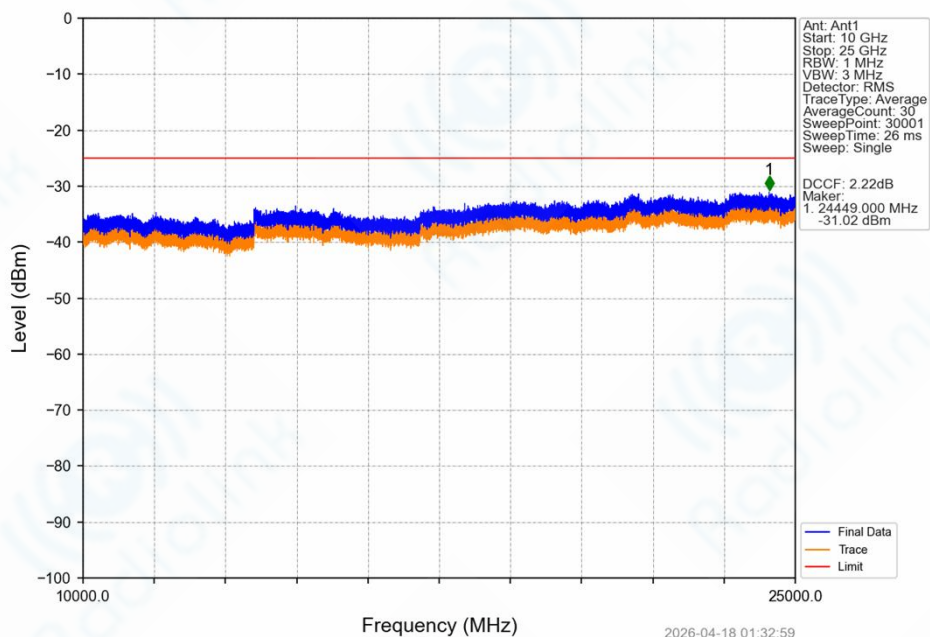

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:16QAM CC2:16QAM_CC1:2665.6 CC2:2680MHz_CC1: 50@0 CC2:
100@0

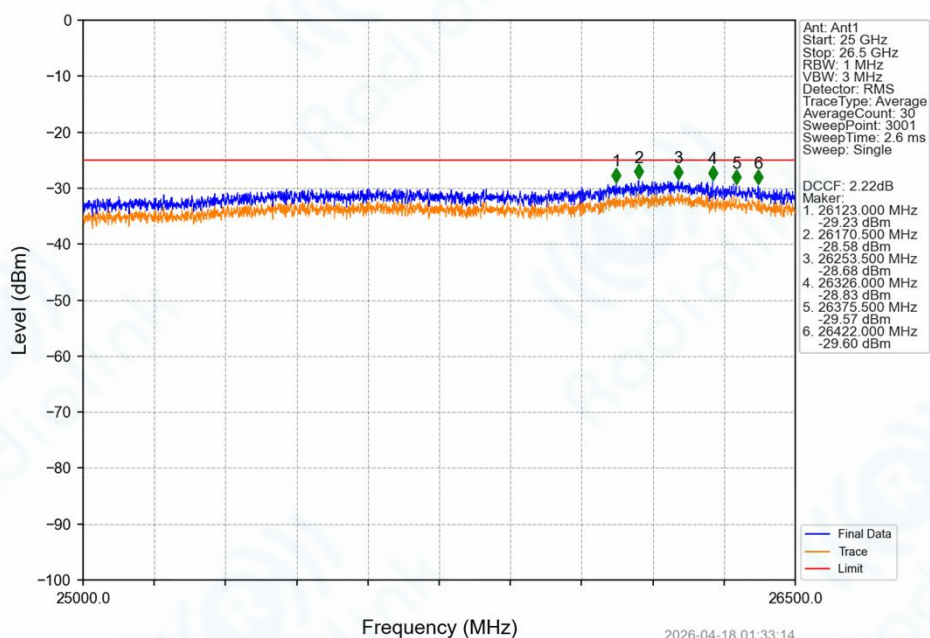

Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694